
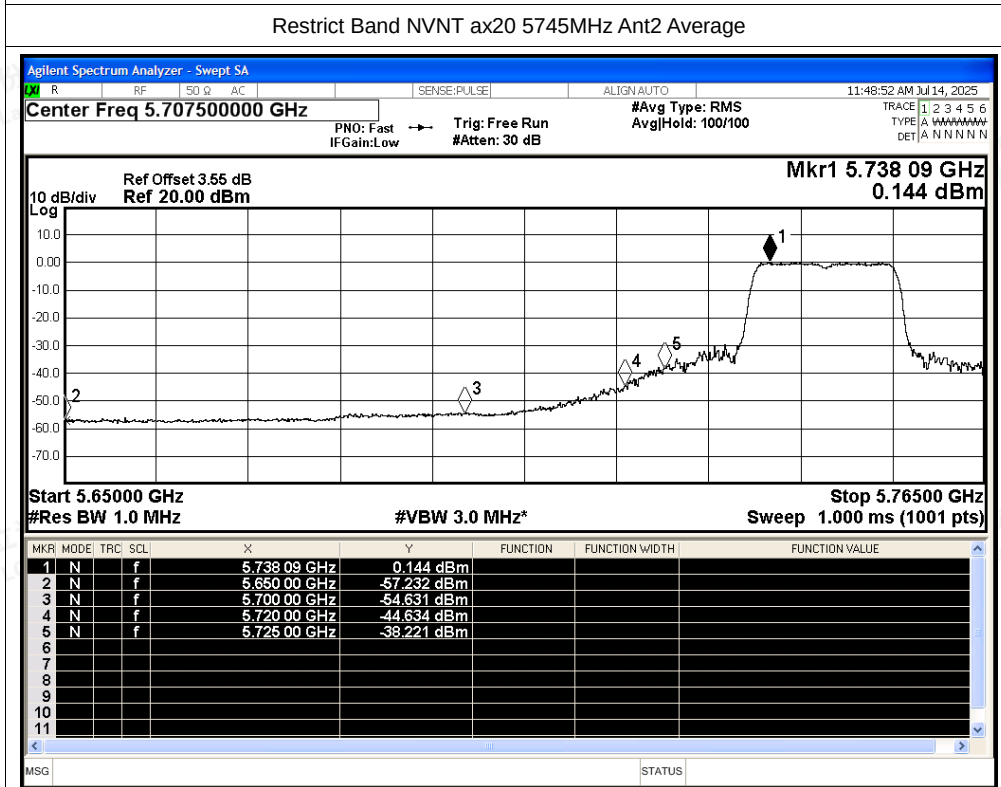


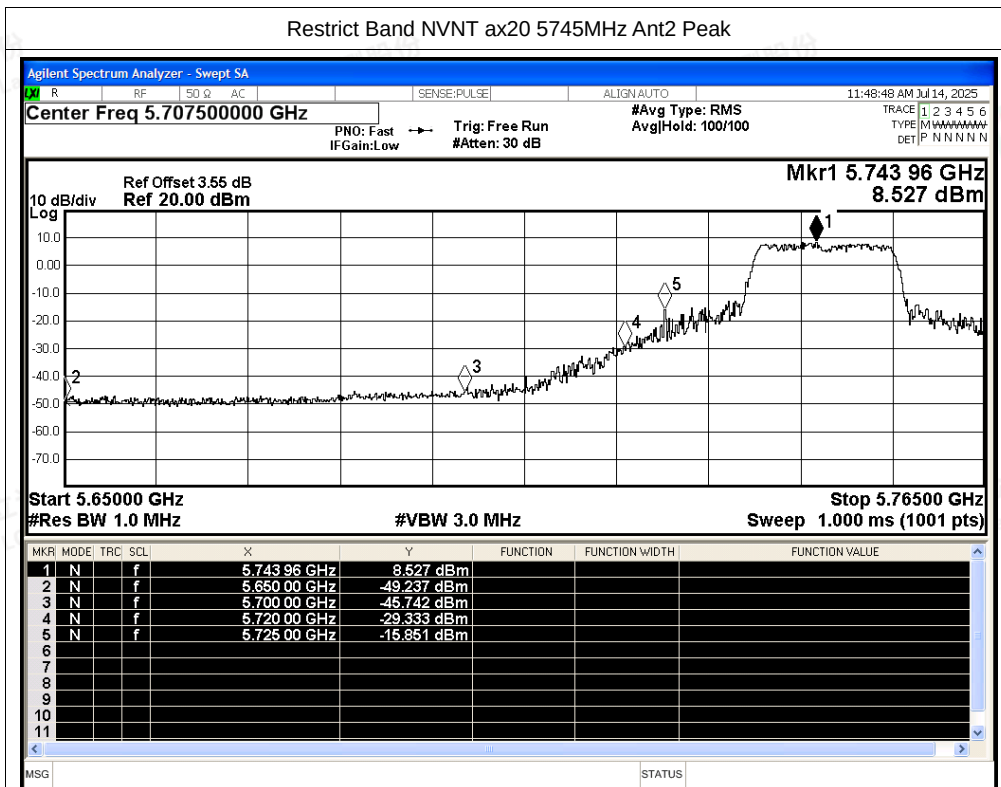

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant2 Peak

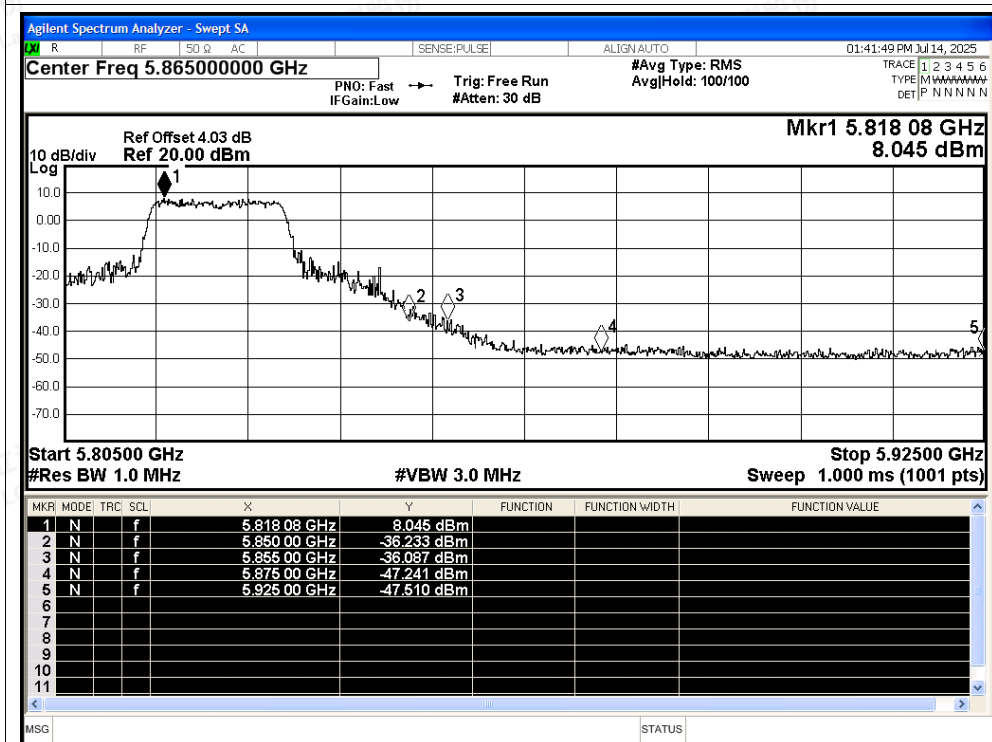

Restrict Band NVNT ax20 5825MHz Ant2 Average

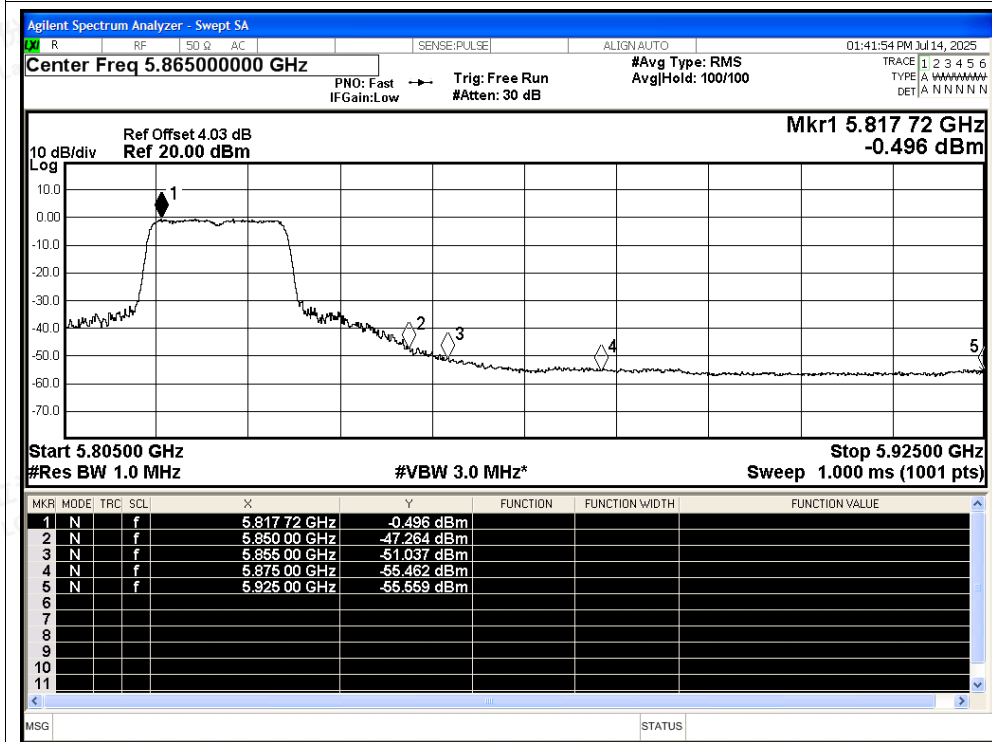

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant2 Peak

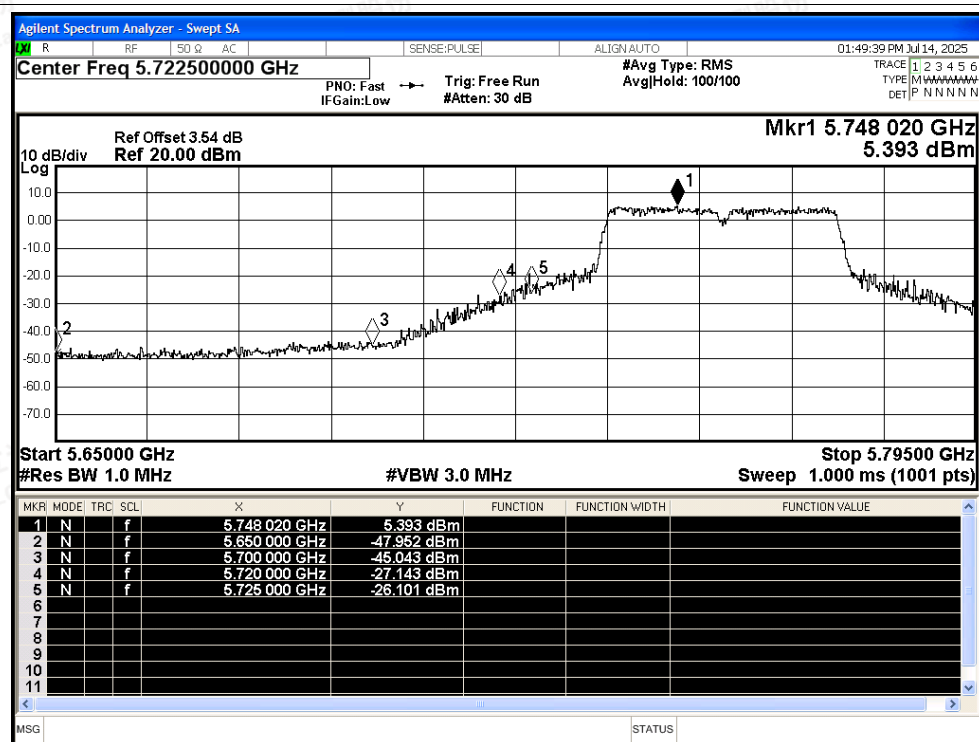

Restrict Band NVNT ax40 5755MHz Ant2 Average

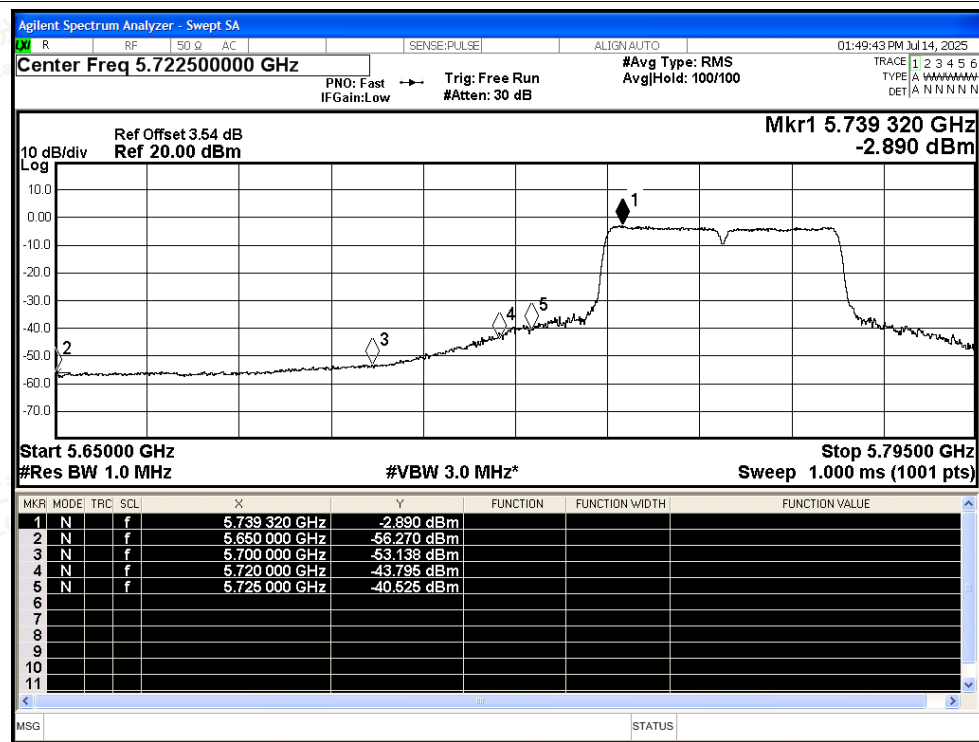

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant2 Peak

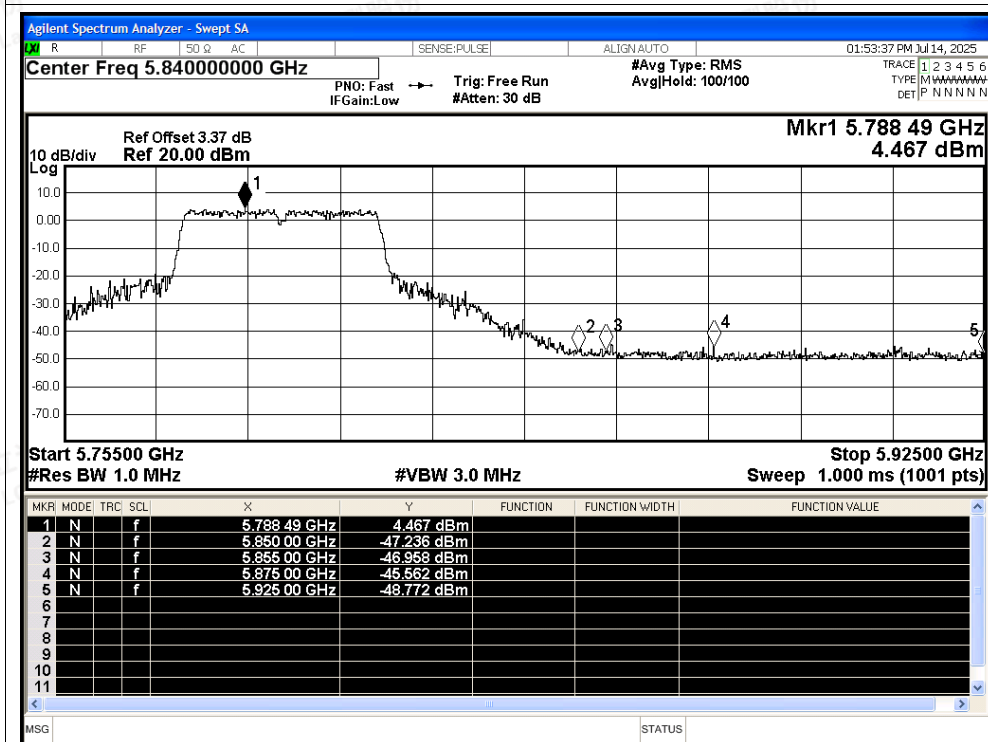

Restrict Band NVNT ax40 5795MHz Ant2 Average

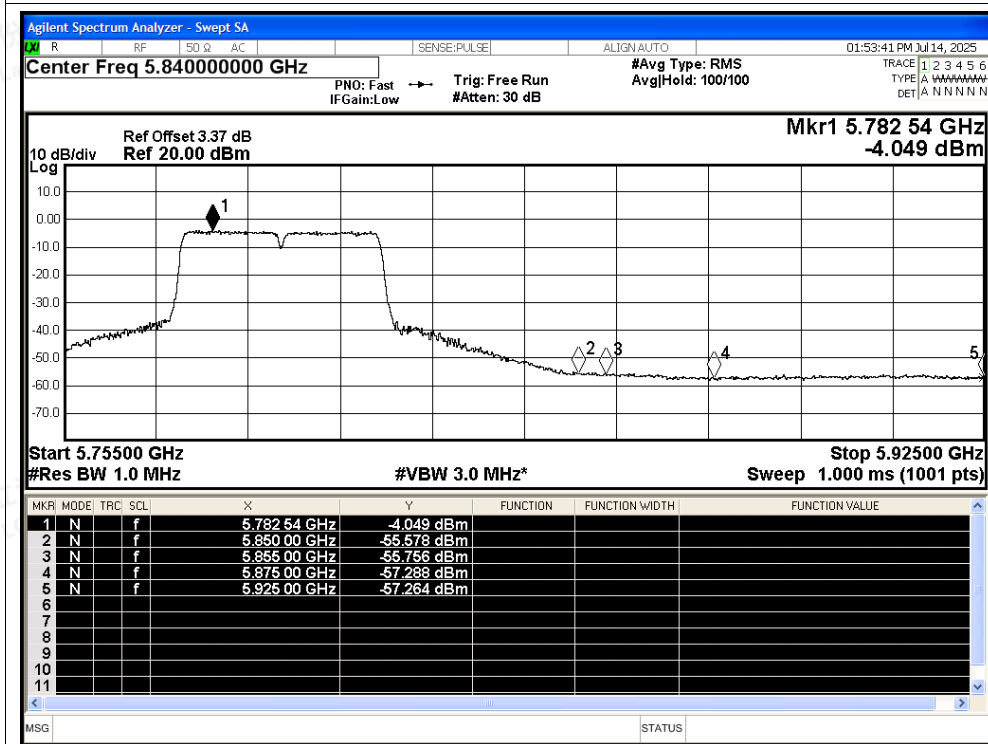

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

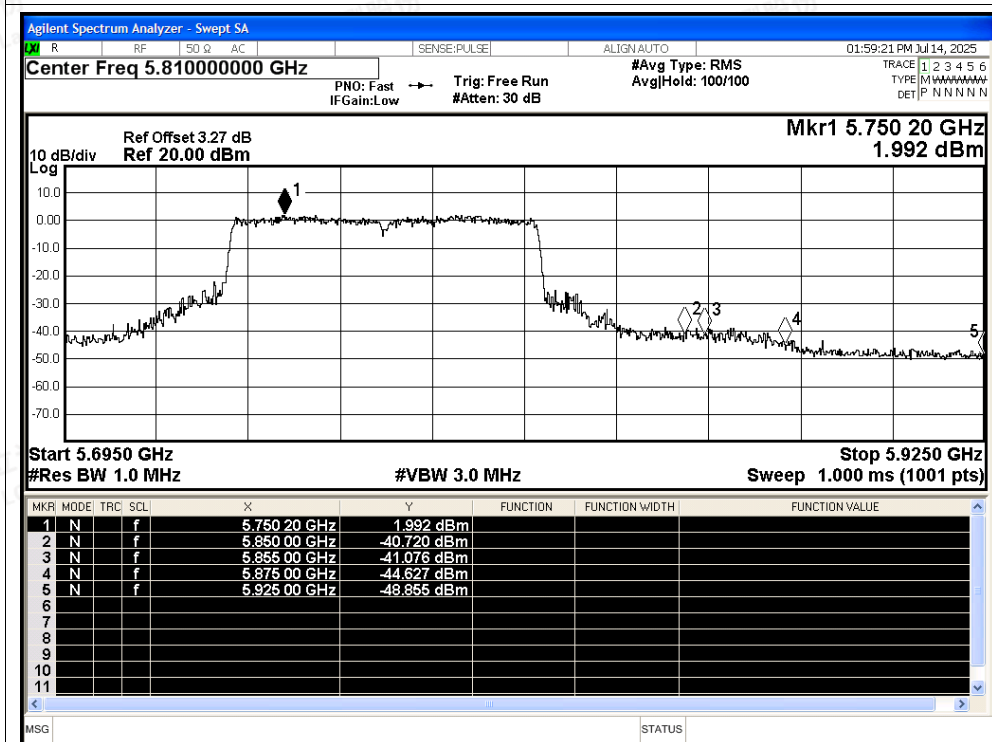

Restrict Band NVNT ax80 5775MHz Ant2 Average

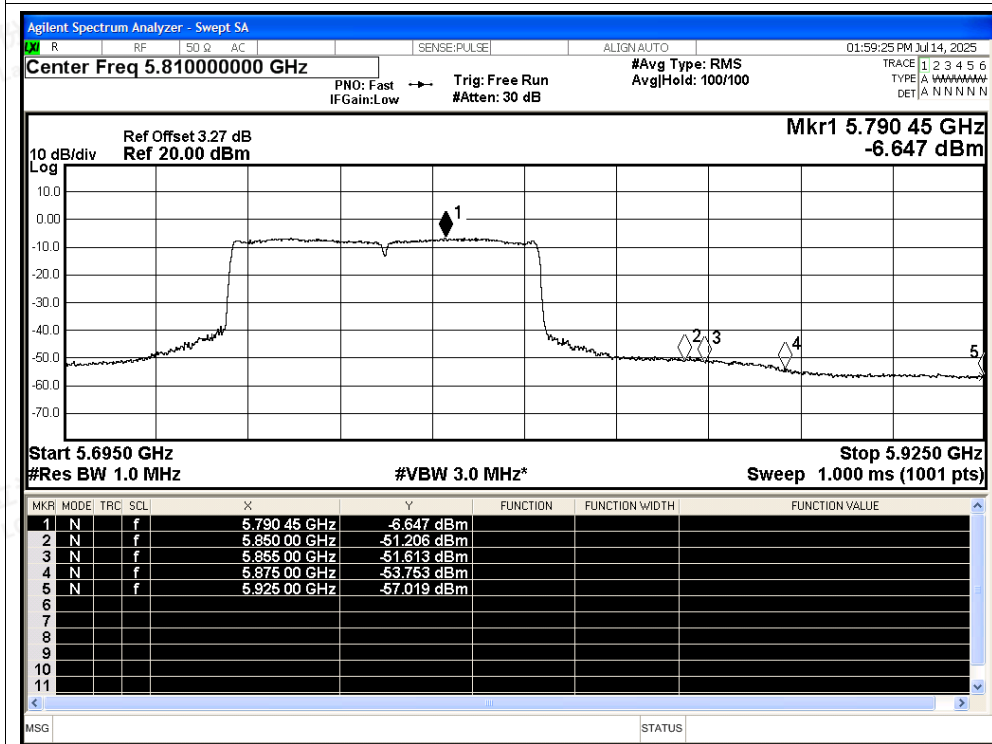

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

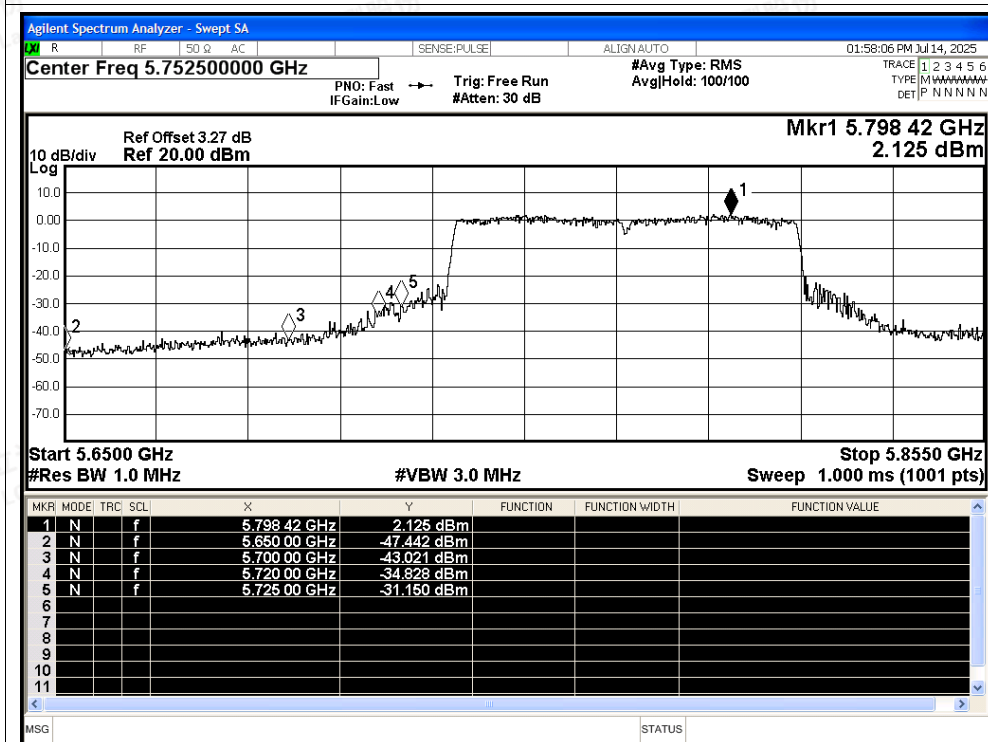

Restrict Band NVNT ax80 5775MHz Ant2 Average

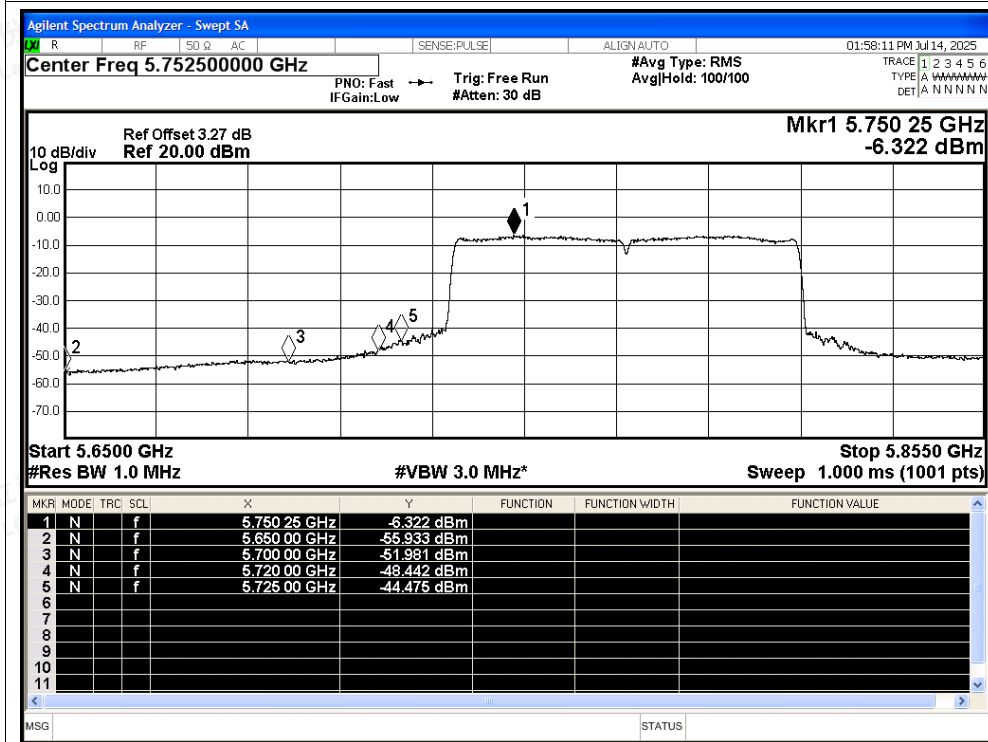

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

**MIMO**

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT1 Power (dBm)	ANT2 Power (dBm)	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	5650	-48.9	-49.36	8.64	-37.47	Peak	-27	Pass
NVNT	n20	5745	5650	-56.61	-56.35	8.64	-44.83	Average	-27	Pass
NVNT	n20	5745	5700	-48.19	-46.39	8.64	-35.55	Peak	10	Pass
NVNT	n20	5745	5700	-55.09	-54.6	8.64	-43.19	Average	10	Pass
NVNT	n20	5745	5720	-30.56	-31.13	8.64	-19.19	Peak	15.6	Pass
NVNT	n20	5745	5720	-44.78	-44.43	8.64	-32.95	Average	15.6	Pass
NVNT	n20	5745	5725	-26.46	-23.56	8.64	-13.12	Peak	27	Pass
NVNT	n20	5745	5725	-40.48	-40.99	8.64	-29.08	Average	27	Pass
NVNT	n20	5825	5850	-31.74	-34.61	8.64	-21.29	Peak	27	Pass
NVNT	n20	5825	5850	-44.02	-47.12	8.64	-33.65	Average	27	Pass
NVNT	n20	5825	5855	-36.45	-42.49	8.64	-26.84	Peak	15.6	Pass
NVNT	n20	5825	5855	-51.12	-52.9	8.64	-40.27	Average	15.6	Pass
NVNT	n20	5825	5875	-47.68	-46.92	8.64	-35.63	Peak	10	Pass
NVNT	n20	5825	5875	-55.33	-55.59	8.64	-43.81	Average	10	Pass
NVNT	n20	5825	5925	-47.89	-48.14	8.64	-36.36	Peak	-27	Pass
NVNT	n20	5825	5925	-55.59	-56	8.64	-44.14	Average	-27	Pass
NVNT	n40	5755	5650	-48.61	-48.06	8.64	-36.68	Peak	-27	Pass
NVNT	n40	5755	5650	-57.23	-56.78	8.64	-45.35	Average	-27	Pass
NVNT	n40	5755	5700	-45.29	-45.08	8.64	-33.53	Peak	10	Pass
NVNT	n40	5755	5700	-53.48	-53.62	8.64	-41.90	Average	10	Pass
NVNT	n40	5755	5720	-30.02	-28.66	8.64	-17.64	Peak	15.6	Pass
NVNT	n40	5755	5720	-44.96	-44.86	8.64	-33.26	Average	15.6	Pass
NVNT	n40	5755	5725	-30.38	-27.39	8.64	-16.98	Peak	27	Pass
NVNT	n40	5755	5725	-41.69	-41.03	8.64	-29.70	Average	27	Pass
NVNT	n40	5795	5850	-48.42	-46.48	8.64	-35.69	Peak	27	Pass
NVNT	n40	5795	5850	-55.57	-55.75	8.64	-44.01	Average	27	Pass
NVNT	n40	5795	5855	-48.75	-48.42	8.64	-36.93	Peak	15.6	Pass
NVNT	n40	5795	5855	-56.39	-55.91	8.64	-44.49	Average	15.6	Pass
NVNT	n40	5795	5875	-50.38	-47.94	8.64	-37.34	Peak	10	Pass
NVNT	n40	5795	5875	-57.34	-57.37	8.64	-45.70	Average	10	Pass
NVNT	n40	5795	5925	-49.48	-49.13	8.64	-37.65	Peak	-27	Pass
NVNT	n40	5795	5925	-56.8	-57.33	8.64	-45.41	Average	-27	Pass
NVNT	ac20	5745	5650	-47.76	-47.56	8.64	-36.01	Peak	-27	Pass
NVNT	ac20	5745	5650	-56.91	-56.96	8.64	-45.28	Average	-27	Pass
NVNT	ac20	5745	5700	-46.71	-46.83	8.64	-35.12	Peak	10	Pass
NVNT	ac20	5745	5700	-54.57	-54.9	8.64	-43.08	Average	10	Pass
NVNT	ac20	5745	5720	-32.04	-28.91	8.64	-18.55	Peak	15.6	Pass
NVNT	ac20	5745	5720	-46.2	-44.53	8.64	-33.63	Average	15.6	Pass
NVNT	ac20	5745	5725	-22.97	-24.34	8.64	-11.95	Peak	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	5725	-38.51	-39.13	8.64	-27.16	Average	27	Pass
NVNT	ac20	5825	5850	-29.41	-33.91	8.64	-19.45	Peak	27	Pass
NVNT	ac20	5825	5850	-43.52	-47.6	8.64	-33.45	Average	27	Pass
NVNT	ac20	5825	5855	-33.54	-39.04	8.64	-23.82	Peak	15.6	Pass
NVNT	ac20	5825	5855	-49.37	-52.02	8.64	-38.85	Average	15.6	Pass
NVNT	ac20	5825	5875	-46.72	-47.44	8.64	-35.41	Peak	10	Pass
NVNT	ac20	5825	5875	-55.2	-54.83	8.64	-43.36	Average	10	Pass
NVNT	ac20	5825	5925	-48.17	-46.28	8.64	-35.47	Peak	-27	Pass
NVNT	ac20	5825	5925	-55.49	-55.47	8.64	-43.83	Average	-27	Pass
NVNT	ac40	5755	5650	-48.44	-48.05	8.64	-36.59	Peak	-27	Pass
NVNT	ac40	5755	5650	-56.7	-56.61	8.64	-45.00	Average	-27	Pass
NVNT	ac40	5755	5700	-44.77	-44.1	8.64	-32.77	Peak	10	Pass
NVNT	ac40	5755	5700	-53.11	-53.25	8.64	-41.53	Average	10	Pass
NVNT	ac40	5755	5720	-28.8	-28.78	8.64	-17.14	Peak	15.6	Pass
NVNT	ac40	5755	5720	-43.47	-42.61	8.64	-31.37	Average	15.6	Pass
NVNT	ac40	5755	5725	-25.63	-28.35	8.64	-15.13	Peak	27	Pass
NVNT	ac40	5755	5725	-39.82	-38.6	8.64	-27.52	Average	27	Pass
NVNT	ac40	5795	5850	-47.43	-46.04	8.64	-35.03	Peak	27	Pass
NVNT	ac40	5795	5850	-56.02	-55.75	8.64	-44.23	Average	27	Pass
NVNT	ac40	5795	5855	-47.58	-46.92	8.64	-35.59	Peak	15.6	Pass
NVNT	ac40	5795	5855	-55.78	-55.97	8.64	-44.22	Average	15.6	Pass
NVNT	ac40	5795	5875	-48.58	-49.55	8.64	-37.39	Peak	10	Pass
NVNT	ac40	5795	5875	-57.33	-57.11	8.64	-45.57	Average	10	Pass
NVNT	ac40	5795	5925	-49.64	-49.79	8.64	-38.06	Peak	-27	Pass
NVNT	ac40	5795	5925	-56.82	-56.98	8.64	-45.25	Average	-27	Pass
NVNT	ac80	5775	5850	-39.46	-39.89	8.64	-28.02	Peak	27	Pass
NVNT	ac80	5775	5850	-49.88	-50.56	8.64	-38.56	Average	27	Pass
NVNT	ac80	5775	5855	-39.46	-38.24	8.64	-27.16	Peak	15.6	Pass
NVNT	ac80	5775	5855	-50.81	-51.49	8.64	-39.49	Average	15.6	Pass
NVNT	ac80	5775	5875	-46.3	-45.11	8.64	-34.01	Peak	10	Pass
NVNT	ac80	5775	5875	-53.58	-54.38	8.64	-42.31	Average	10	Pass
NVNT	ac80	5775	5925	-47.67	-49.59	8.64	-36.87	Peak	-27	Pass
NVNT	ac80	5775	5925	-57.23	-56.86	8.64	-45.39	Average	-27	Pass
NVNT	ac80	5775	5650	-47.43	-47.48	8.64	-35.80	Peak	-27	Pass
NVNT	ac80	5775	5650	-56.03	-55.77	8.64	-44.25	Average	-27	Pass
NVNT	ac80	5775	5700	-43.79	-41.48	8.64	-30.83	Peak	10	Pass
NVNT	ac80	5775	5700	-51.02	-51.76	8.64	-39.72	Average	10	Pass
NVNT	ac80	5775	5720	-34.76	-34.25	8.64	-22.85	Peak	15.6	Pass
NVNT	ac80	5775	5720	-45.32	-47.47	8.64	-34.61	Average	15.6	Pass
NVNT	ac80	5775	5725	-29.4	-31.4	8.64	-18.64	Peak	27	Pass
NVNT	ac80	5775	5725	-45.29	-45.98	8.64	-33.97	Average	27	Pass
NVNT	ax20	5745	5650	-48.71	-49.24	8.64	-37.32	Peak	-27	Pass
NVNT	ax20	5745	5650	-56.86	-57.23	8.64	-45.39	Average	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5745	5700	-46.55	-45.74	8.64	-34.48	Peak	10	Pass
NVNT	ax20	5745	5700	-54.76	-54.63	8.64	-43.04	Average	10	Pass
NVNT	ax20	5745	5720	-32.58	-29.33	8.64	-19.01	Peak	15.6	Pass
NVNT	ax20	5745	5720	-44.7	-44.63	8.64	-33.01	Average	15.6	Pass
NVNT	ax20	5745	5725	-27.82	-15.85	8.64	-6.94	Peak	27	Pass
NVNT	ax20	5745	5725	-40.08	-38.22	8.64	-27.40	Average	27	Pass
NVNT	ax20	5825	5850	-27.87	-36.23	8.64	-18.64	Peak	27	Pass
NVNT	ax20	5825	5850	-42.94	-47.26	8.64	-32.93	Average	27	Pass
NVNT	ax20	5825	5855	-30.5	-36.09	8.64	-20.80	Peak	15.6	Pass
NVNT	ax20	5825	5855	-47.66	-51.04	8.64	-37.38	Average	15.6	Pass
NVNT	ax20	5825	5875	-47.38	-47.24	8.64	-35.66	Peak	10	Pass
NVNT	ax20	5825	5875	-55.28	-55.46	8.64	-43.72	Average	10	Pass
NVNT	ax20	5825	5925	-47.14	-47.51	8.64	-35.67	Peak	-27	Pass
NVNT	ax20	5825	5925	-56.33	-55.56	8.64	-44.28	Average	-27	Pass
NVNT	ax40	5755	5650	-49.03	-47.95	8.64	-36.81	Peak	-27	Pass
NVNT	ax40	5755	5650	-57.12	-56.27	8.64	-45.02	Average	-27	Pass
NVNT	ax40	5755	5700	-44.71	-45.04	8.64	-33.22	Peak	10	Pass
NVNT	ax40	5755	5700	-52.42	-53.14	8.64	-41.11	Average	10	Pass
NVNT	ax40	5755	5720	-30.56	-27.14	8.64	-16.87	Peak	15.6	Pass
NVNT	ax40	5755	5720	-44.05	-43.8	8.64	-32.27	Average	15.6	Pass
NVNT	ax40	5755	5725	-26.46	-26.1	8.64	-14.63	Peak	27	Pass
NVNT	ax40	5755	5725	-39.57	-40.53	8.64	-28.37	Average	27	Pass
NVNT	ax40	5795	5850	-47.67	-47.24	8.64	-35.80	Peak	27	Pass
NVNT	ax40	5795	5850	-55.81	-55.58	8.64	-44.04	Average	27	Pass
NVNT	ax40	5795	5855	-47.98	-46.96	8.64	-35.79	Peak	15.6	Pass
NVNT	ax40	5795	5855	-55.66	-55.76	8.64	-44.06	Average	15.6	Pass
NVNT	ax40	5795	5875	-49.38	-45.56	8.64	-35.41	Peak	10	Pass
NVNT	ax40	5795	5875	-57.02	-57.29	8.64	-45.50	Average	10	Pass
NVNT	ax40	5795	5925	-48.4	-48.77	8.64	-36.93	Peak	-27	Pass
NVNT	ax40	5795	5925	-57.4	-57.26	8.64	-45.68	Average	-27	Pass
NVNT	ax80	5775	5850	-39.74	-40.72	8.64	-28.55	Peak	27	Pass
NVNT	ax80	5775	5850	-49.84	-51.21	8.64	-38.82	Average	27	Pass
NVNT	ax80	5775	5855	-40.17	-41.08	8.64	-28.95	Peak	15.6	Pass
NVNT	ax80	5775	5855	-51.11	-51.61	8.64	-39.70	Average	15.6	Pass
NVNT	ax80	5775	5875	-45.54	-44.63	8.64	-33.41	Peak	10	Pass
NVNT	ax80	5775	5875	-53.79	-53.75	8.64	-42.12	Average	10	Pass
NVNT	ax80	5775	5925	-48.51	-48.86	8.64	-37.03	Peak	-27	Pass
NVNT	ax80	5775	5925	-56.77	-57.02	8.64	-45.24	Average	-27	Pass
NVNT	ax80	5775	5650	-48.07	-47.44	8.64	-36.09	Peak	-27	Pass
NVNT	ax80	5775	5650	-55.48	-55.93	8.64	-44.05	Average	-27	Pass
NVNT	ax80	5775	5700	-41.5	-43.02	8.64	-30.54	Peak	10	Pass
NVNT	ax80	5775	5700	-51.95	-51.98	8.64	-40.31	Average	10	Pass
NVNT	ax80	5775	5720	-34.3	-34.83	8.64	-22.91	Peak	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	5720	-47.07	-48.44	8.64	-36.05	Average	15.6	Pass
NVNT	ax80	5775	5725	-28.74	-31.15	8.64	-18.13	Peak	27	Pass
NVNT	ax80	5775	5725	-45.12	-44.48	8.64	-33.14	Average	27	Pass

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab

立讯检测股份
LCS Testing Lab



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



E.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant1	5745	0	0	25	Pass
NVNT	a	5785	Ant1	5785	0	0	25	Pass
NVNT	a	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant1	5785	0	0	25	Pass
NVNT	n20	5825	Ant1	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant1	5755	0	0	25	Pass
NVNT	n40	5795	Ant1	5795	0	0	25	Pass
NVNT	ac20	5745	Ant1	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant1	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant1	5825	0	0	25	Pass
NVNT	ac40	5755	Ant1	5755	0	0	25	Pass
NVNT	ac40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant1	5775	0	0	25	Pass
NVNT	ax20	5745	Ant1	5745.02	20000	3.48	25	Pass
NVNT	ax20	5785	Ant1	5785	0	0	25	Pass
NVNT	ax20	5825	Ant1	5825	0	0	25	Pass
NVNT	ax40	5755	Ant1	5755	0	0	25	Pass
NVNT	ax40	5795	Ant1	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant1	5775	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5745MHz Ant1

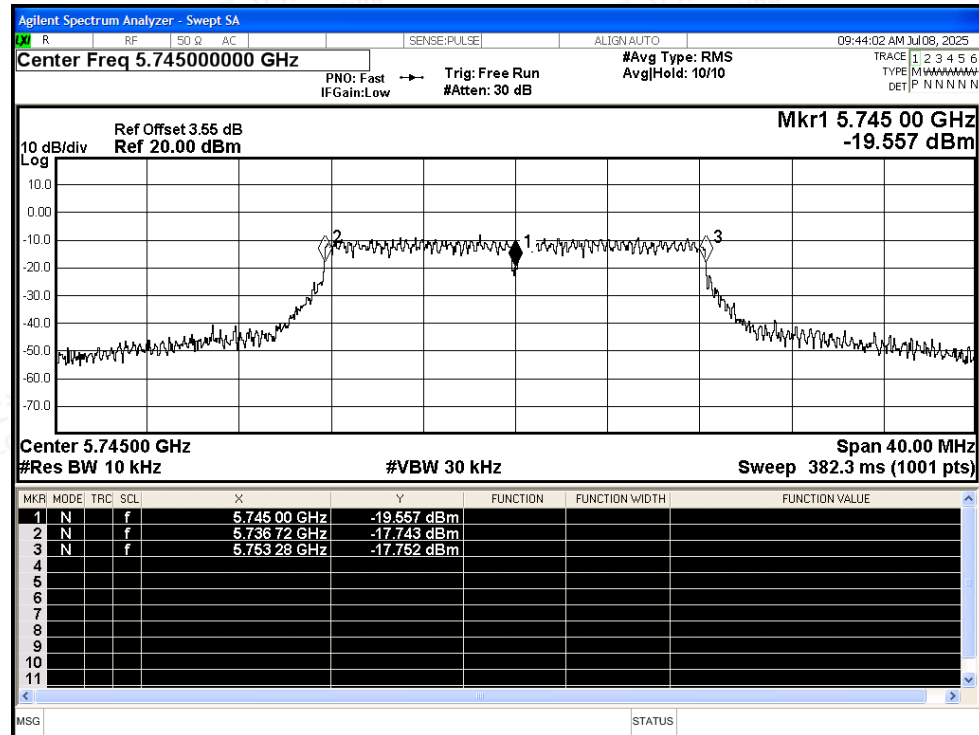

Freq. Stability NVNT a 5785MHz Ant1

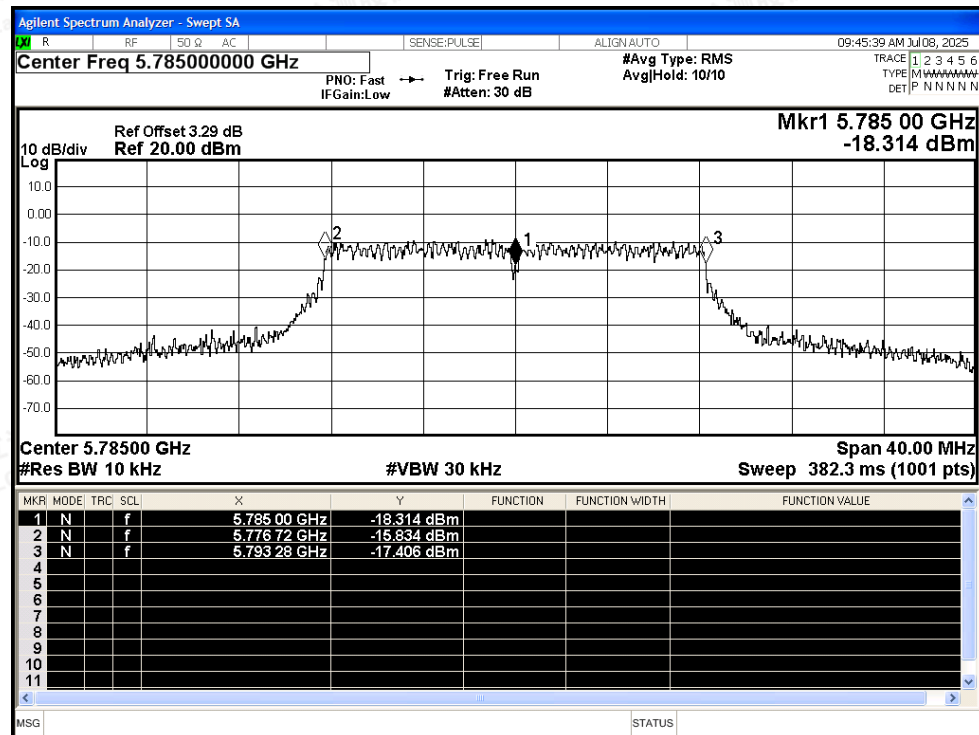

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant1

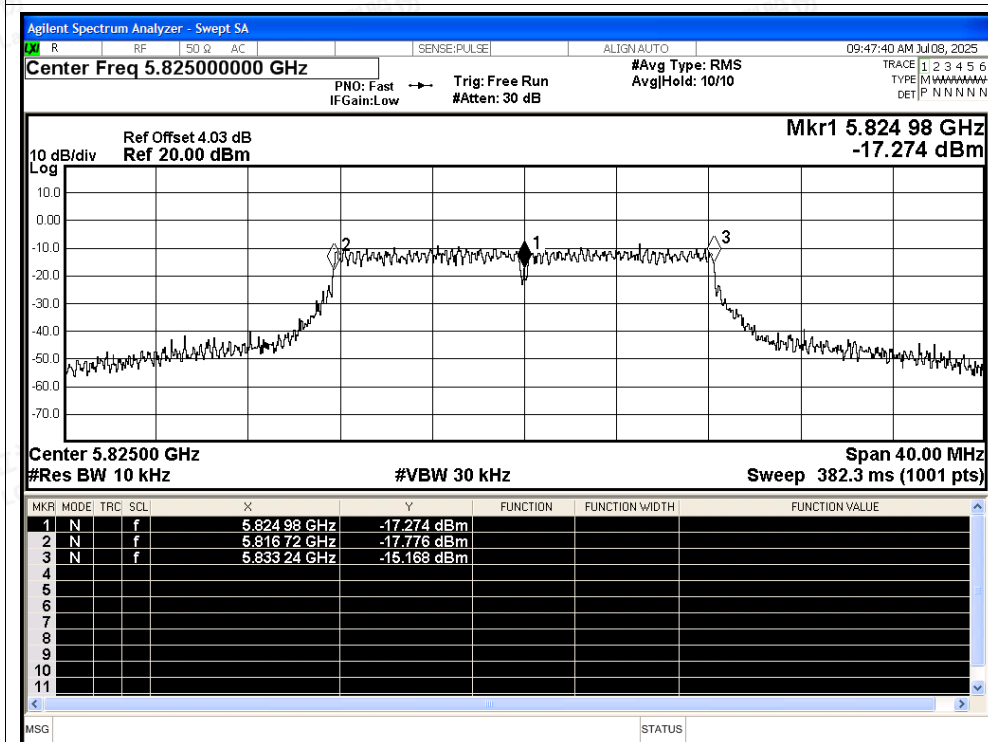

Freq. Stability NVNT n20 5745MHz Ant1


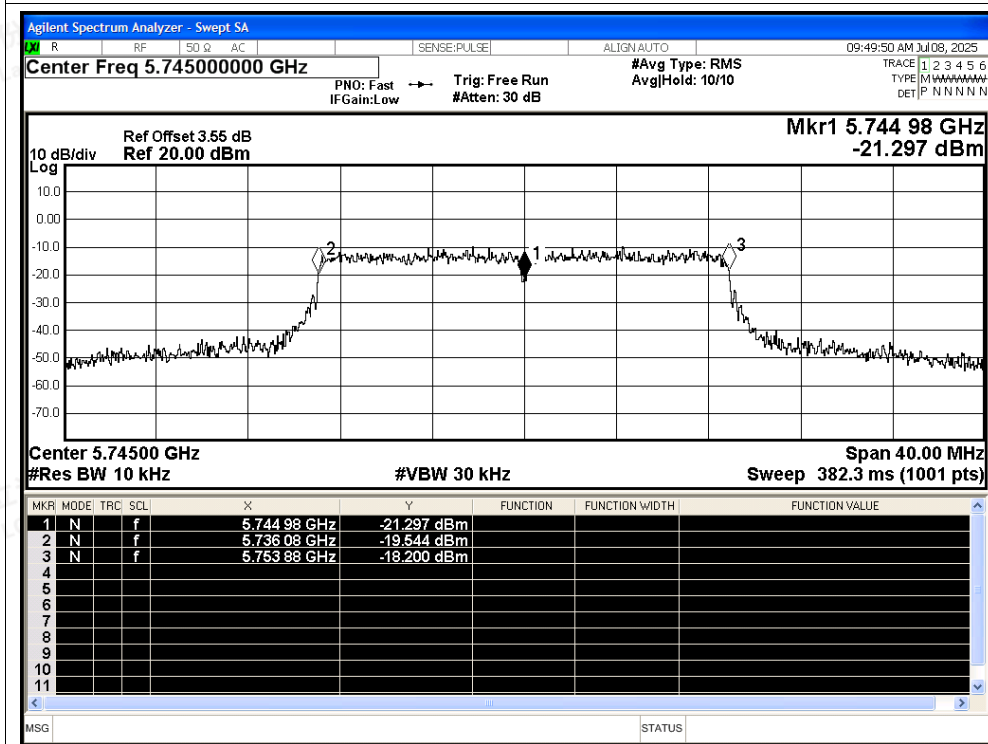


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

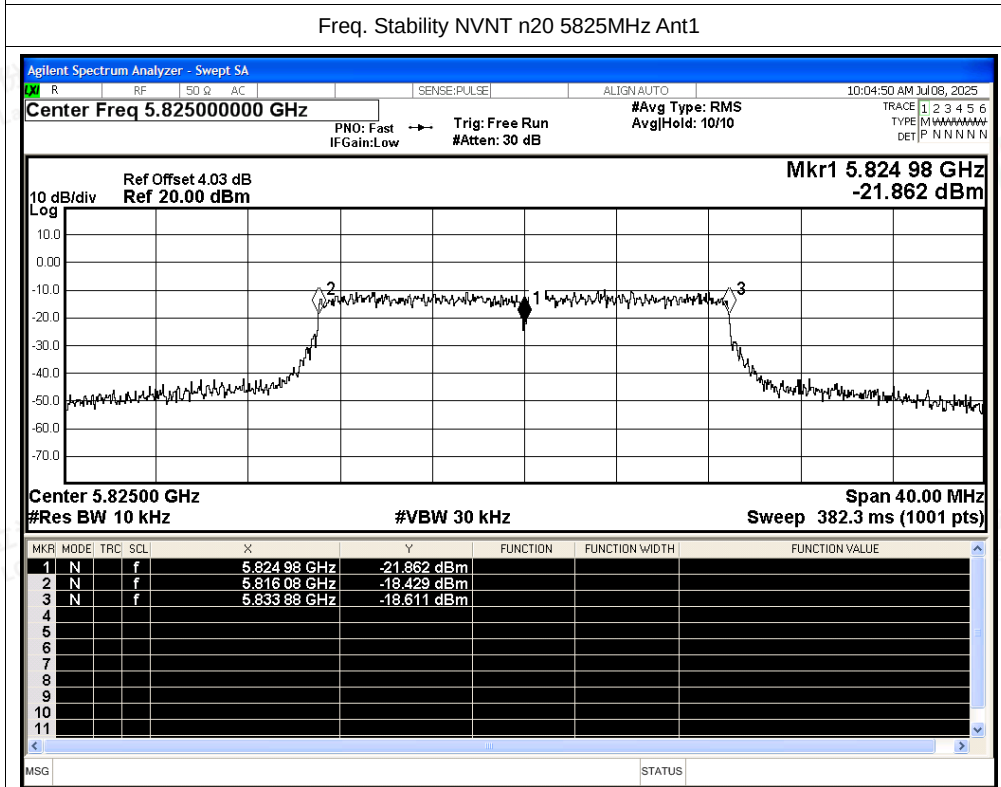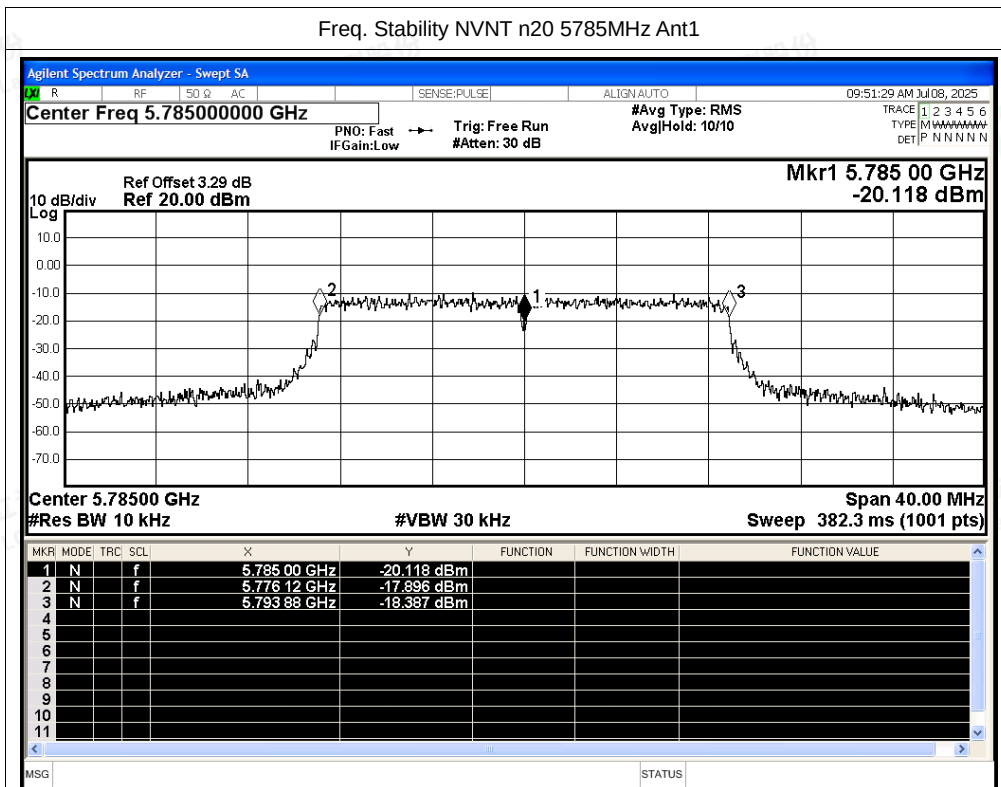

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant1

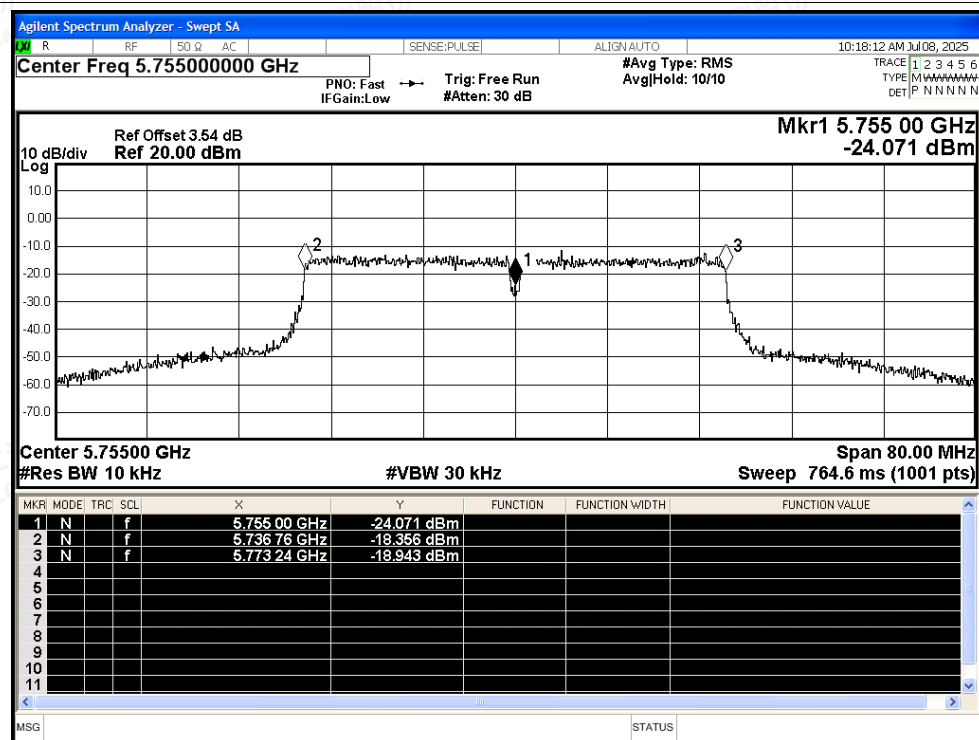

Freq. Stability NVNT n40 5795MHz Ant1

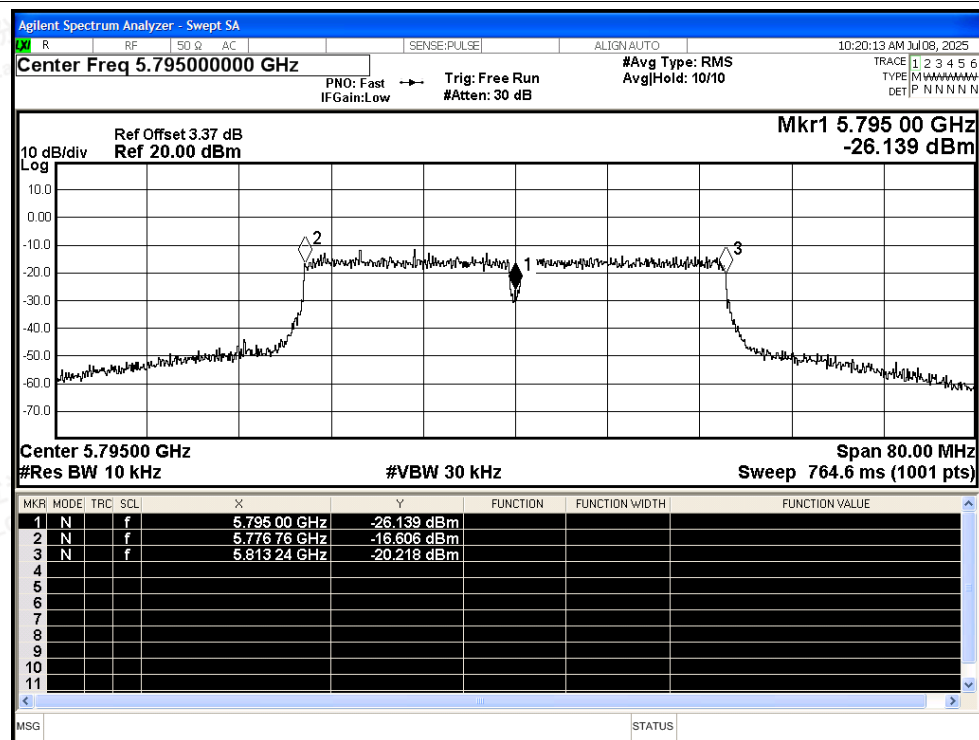

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant1

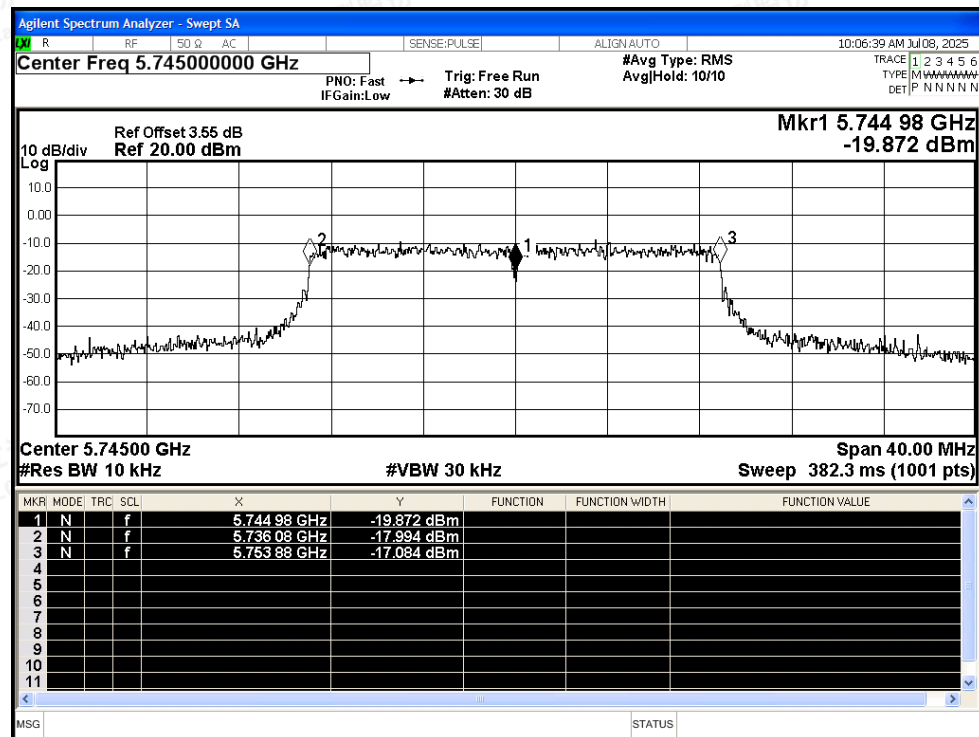

Freq. Stability NVNT ac20 5785MHz Ant1


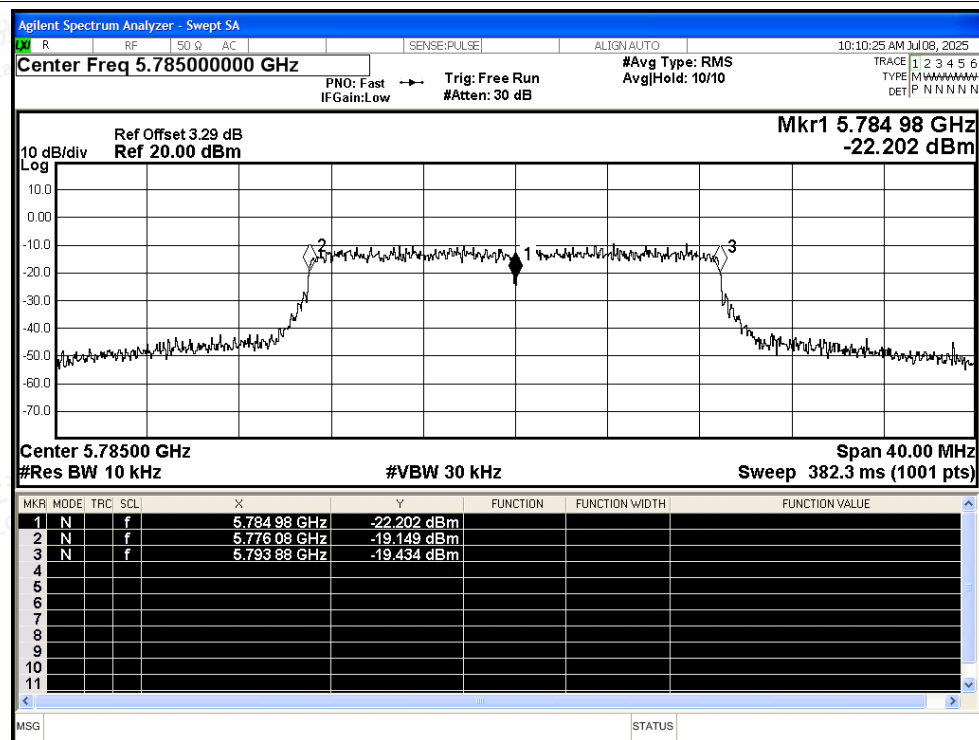


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

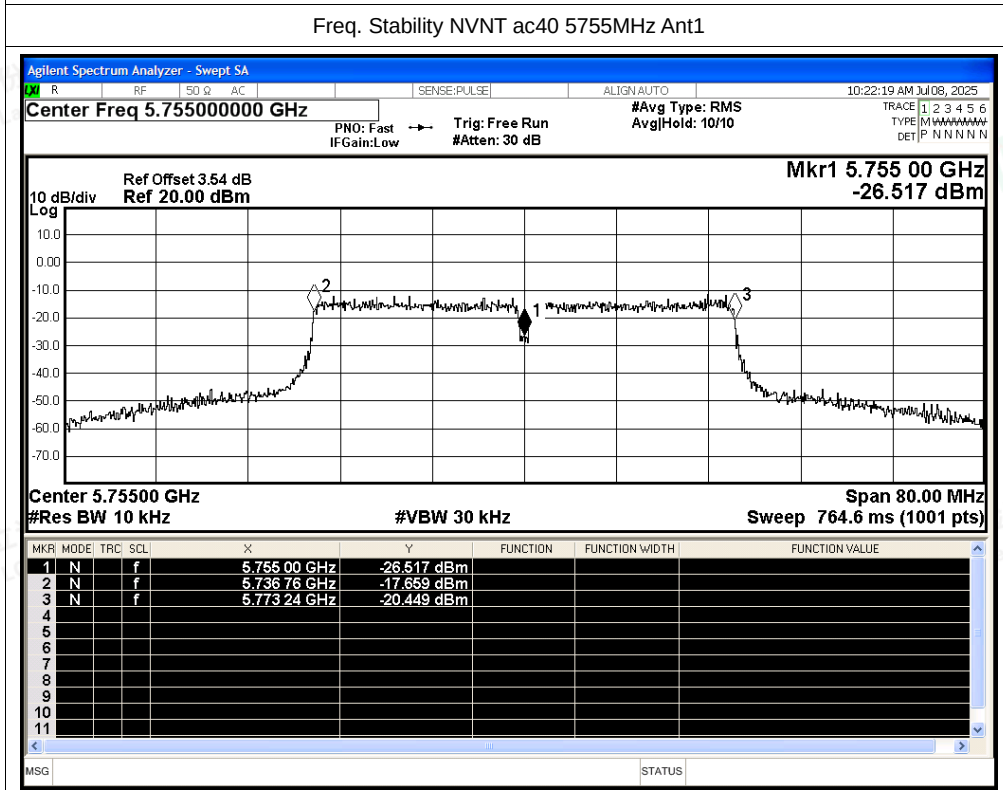
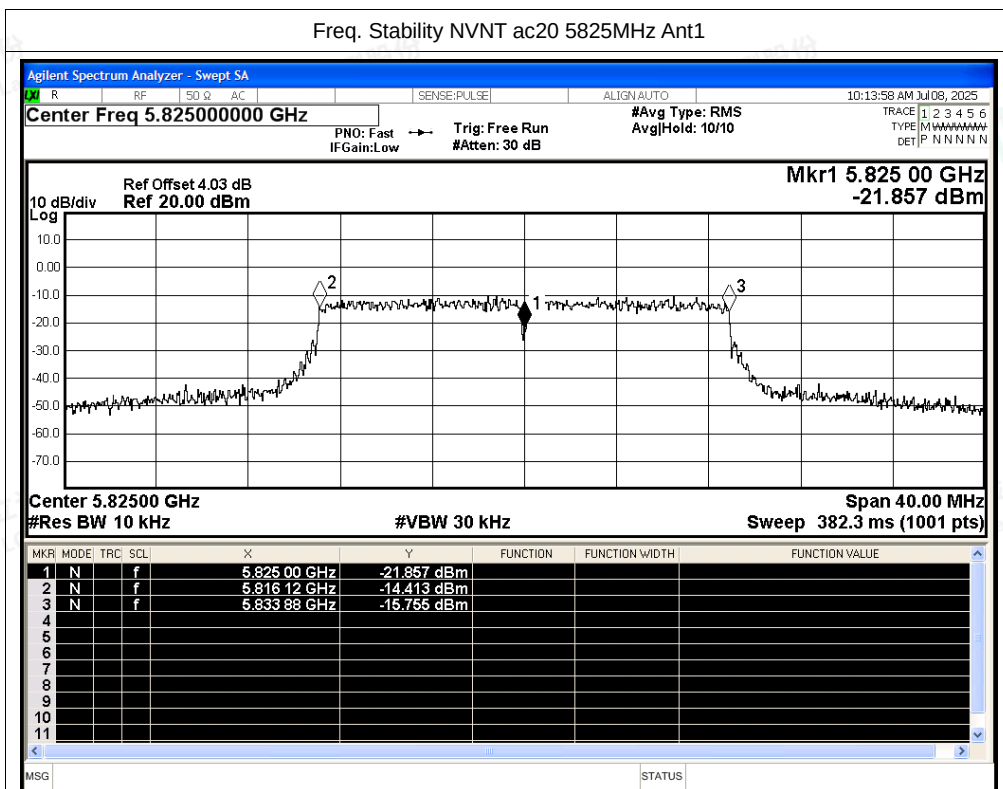


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

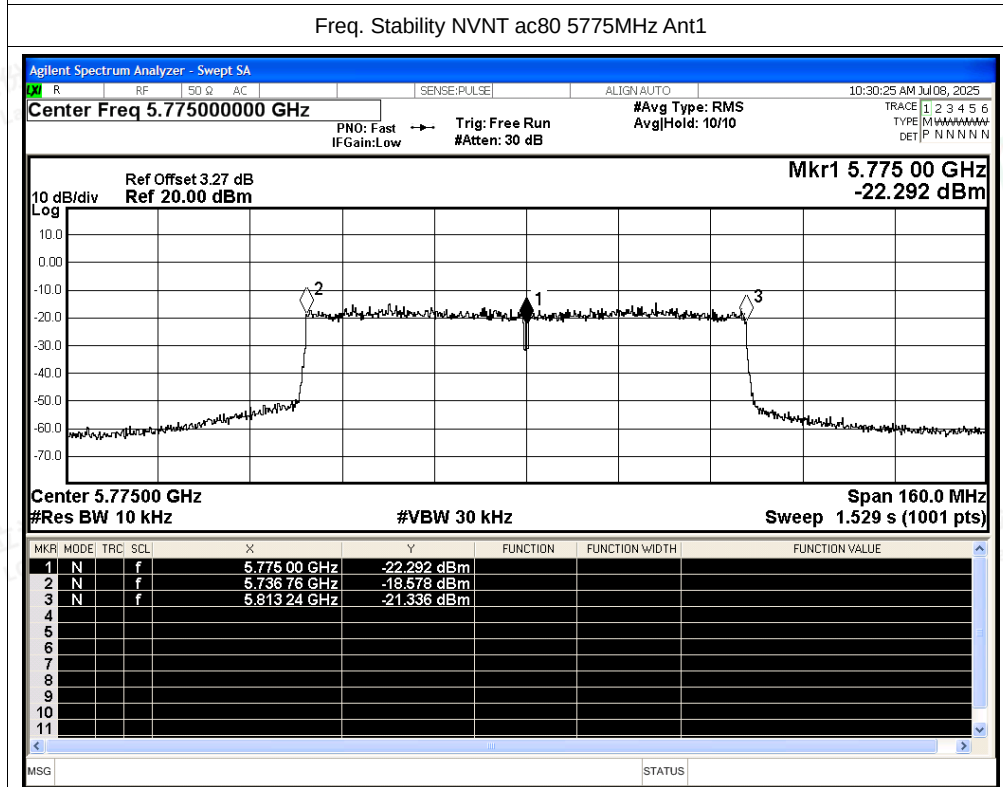
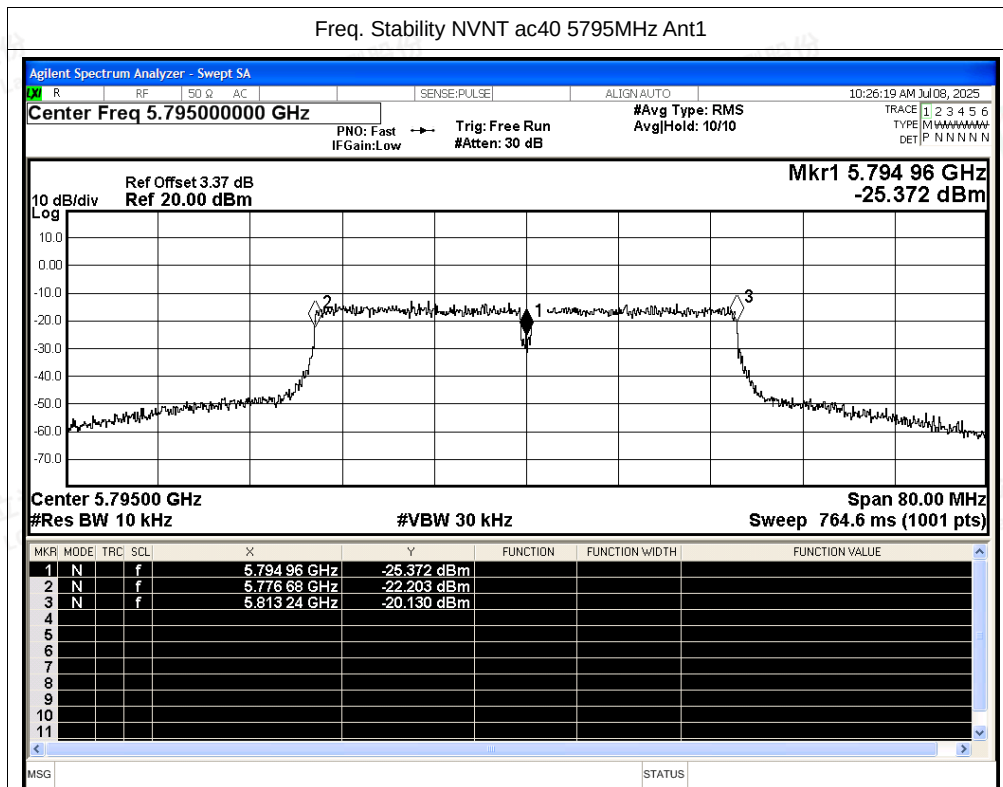


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

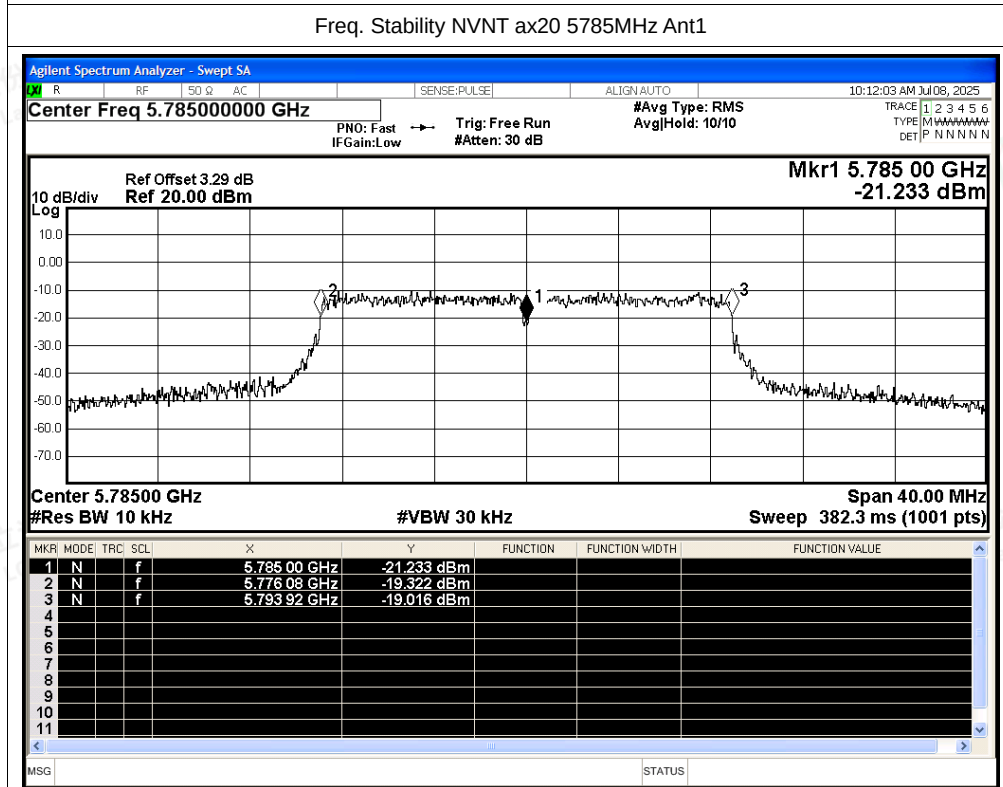
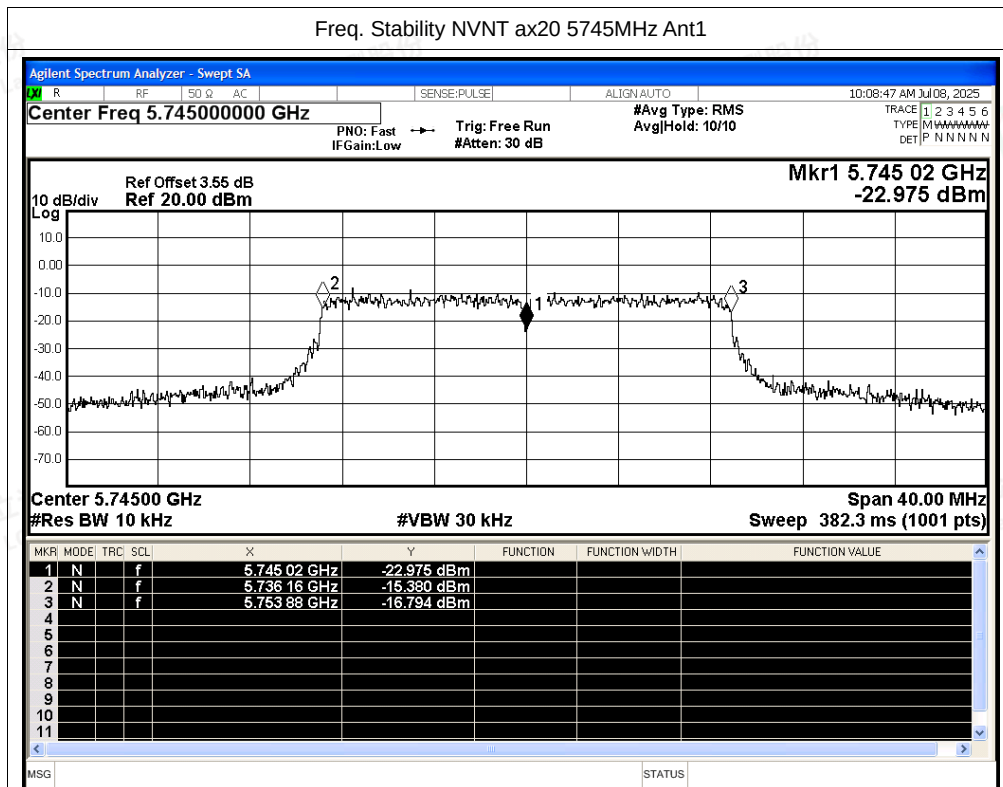


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

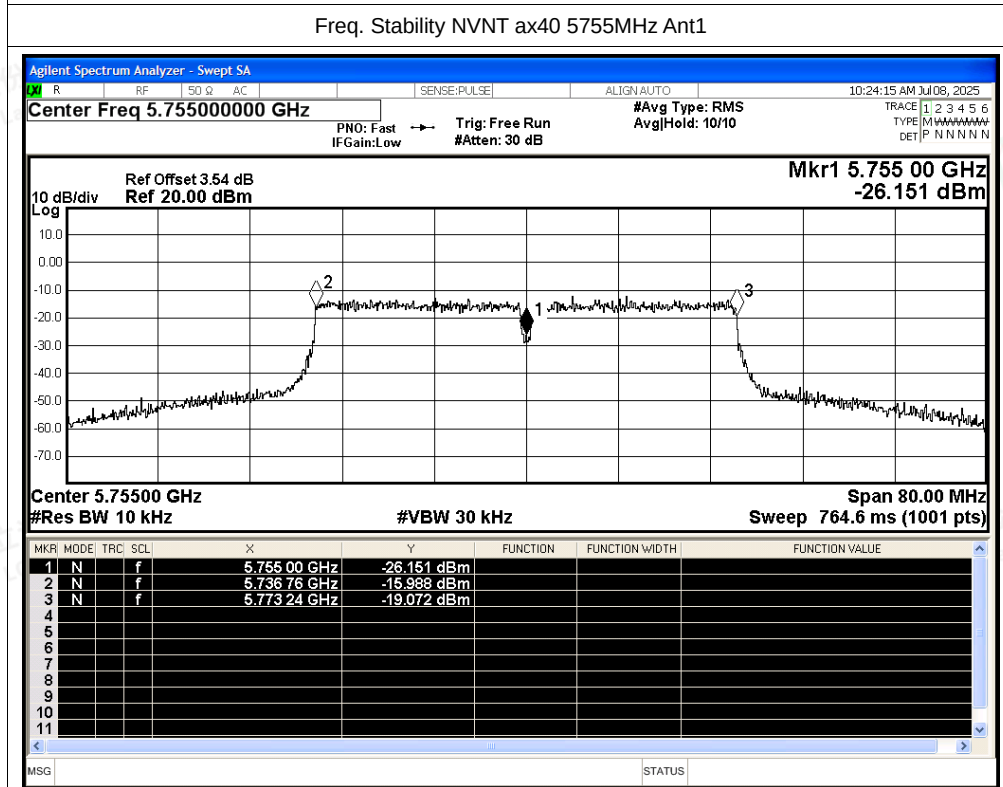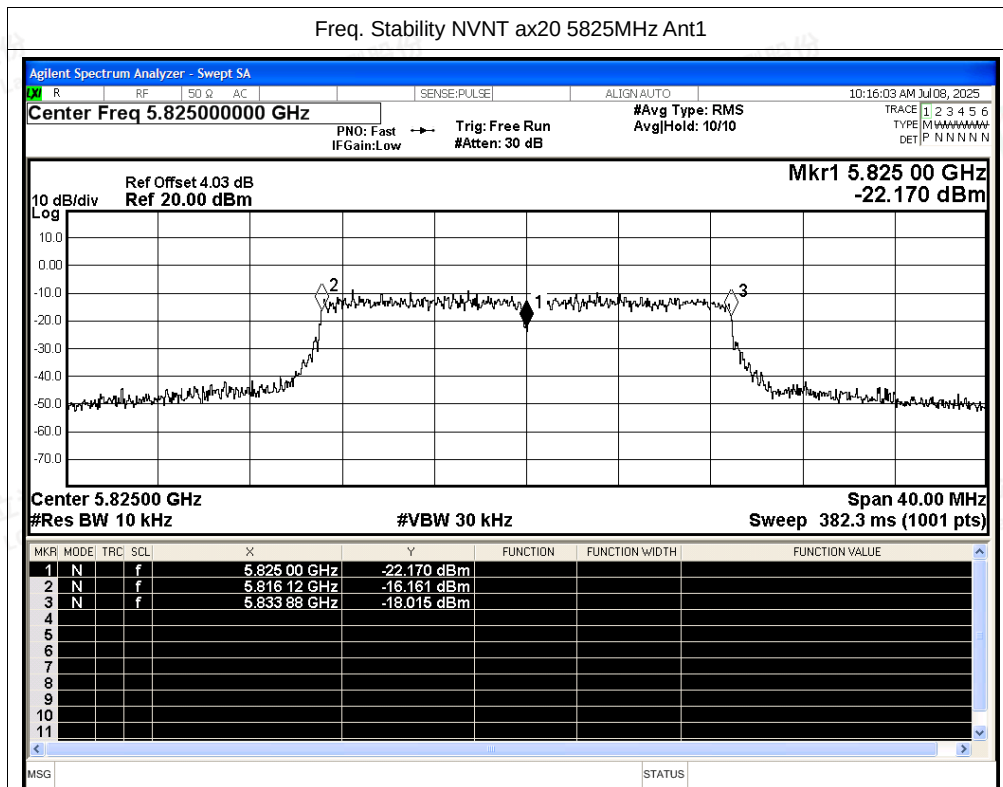

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant1

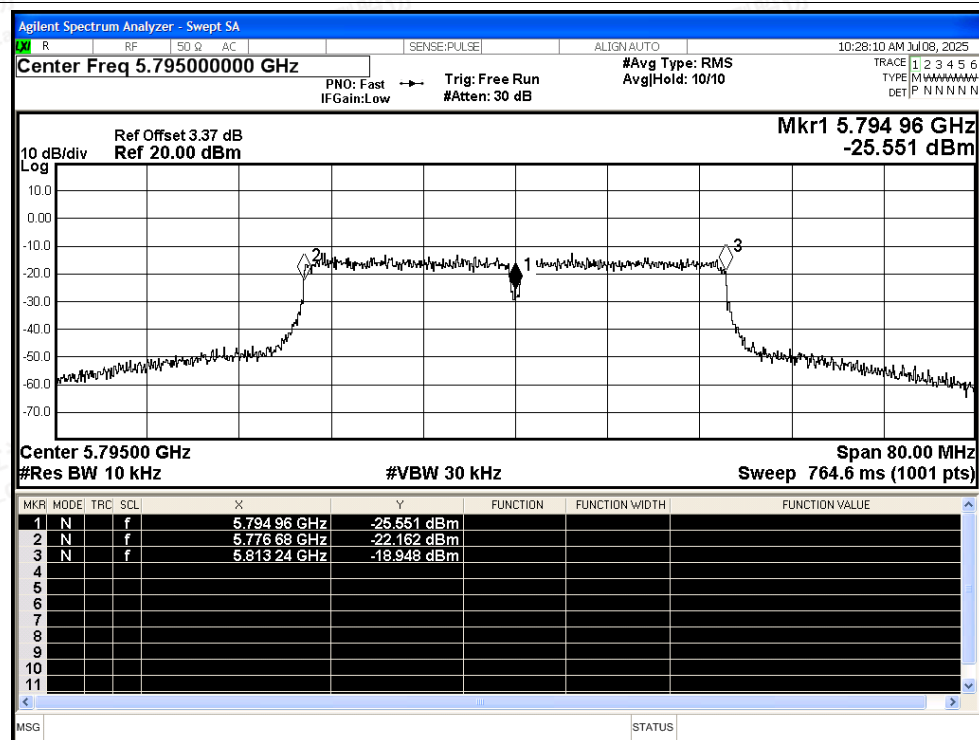

Freq. Stability NVNT ax80 5775MHz Ant1

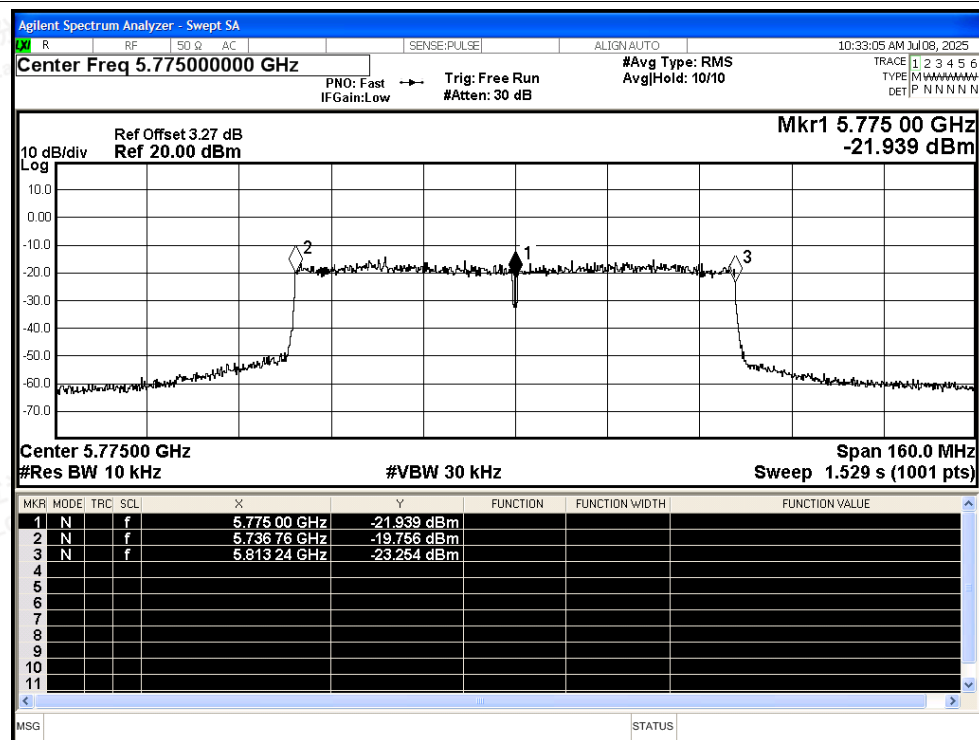

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant2	5745	0	0	25	Pass
NVNT	a	5785	Ant2	5785	0	0	25	Pass
NVNT	a	5825	Ant2	5825	0	0	25	Pass
NVNT	n20	5745	Ant2	5745	0	0	25	Pass
NVNT	n20	5785	Ant2	5785.02	20000	3.46	25	Pass
NVNT	n20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac20	5745	Ant2	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant2	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant2	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant2	5755	0	0	25	Pass
NVNT	ac40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass
NVNT	ax20	5745	Ant2	5745	0	0	25	Pass
NVNT	ax20	5785	Ant2	5784.96	-40000	-6.91	25	Pass
NVNT	ax20	5825	Ant2	5825	0	0	25	Pass
NVNT	ax40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ax40	5795	Ant2	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant2	5775	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5745MHz Ant2

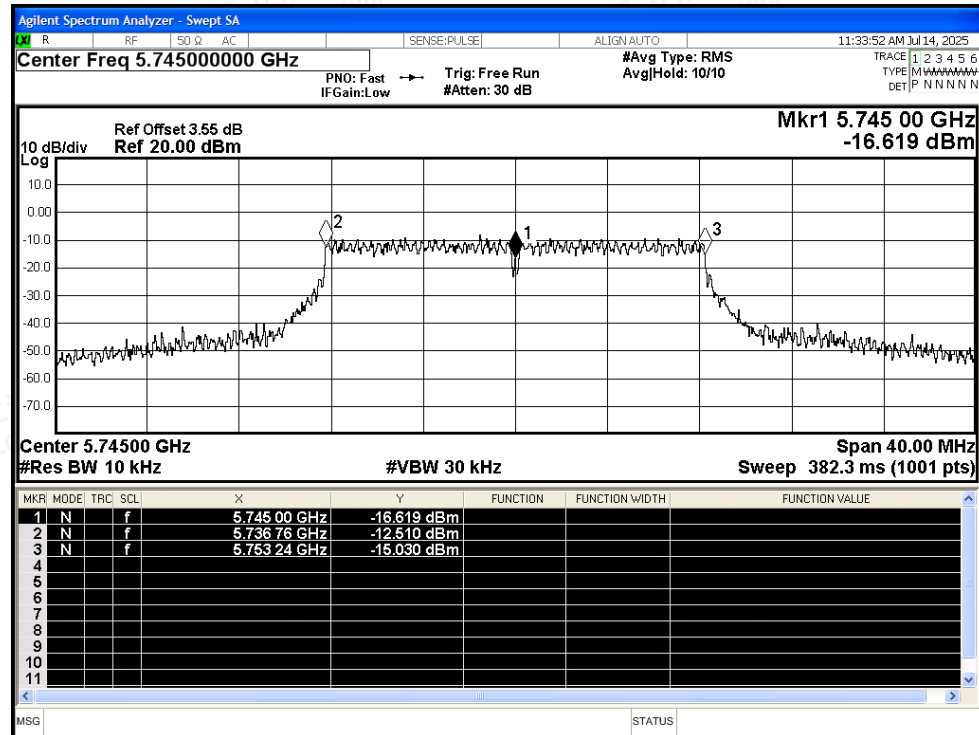

Freq. Stability NVNT a 5785MHz Ant2


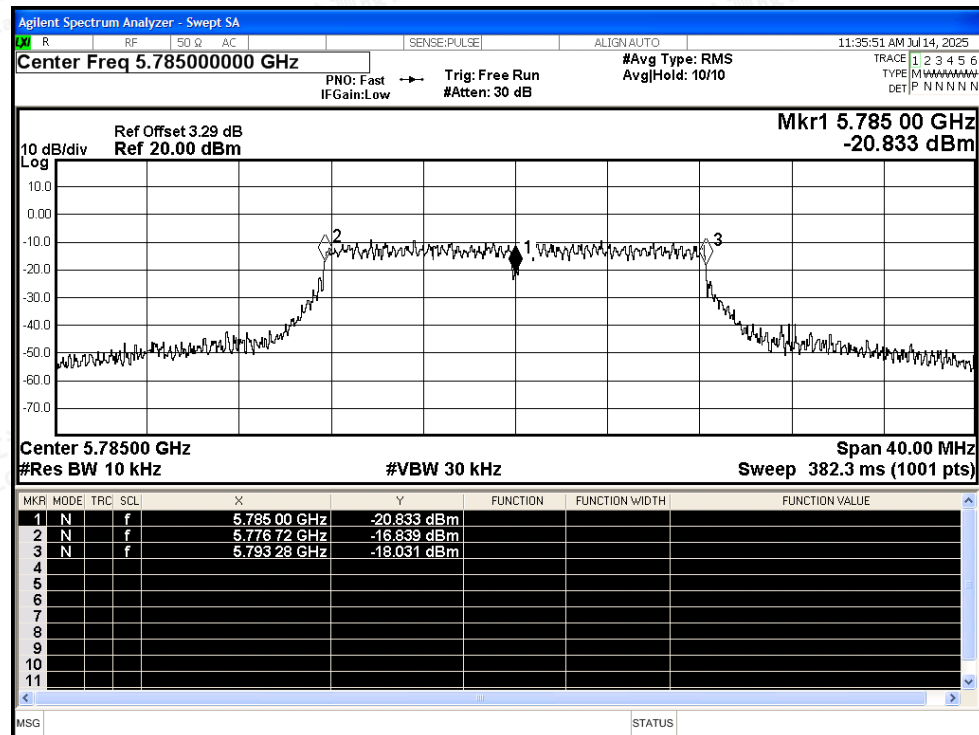


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

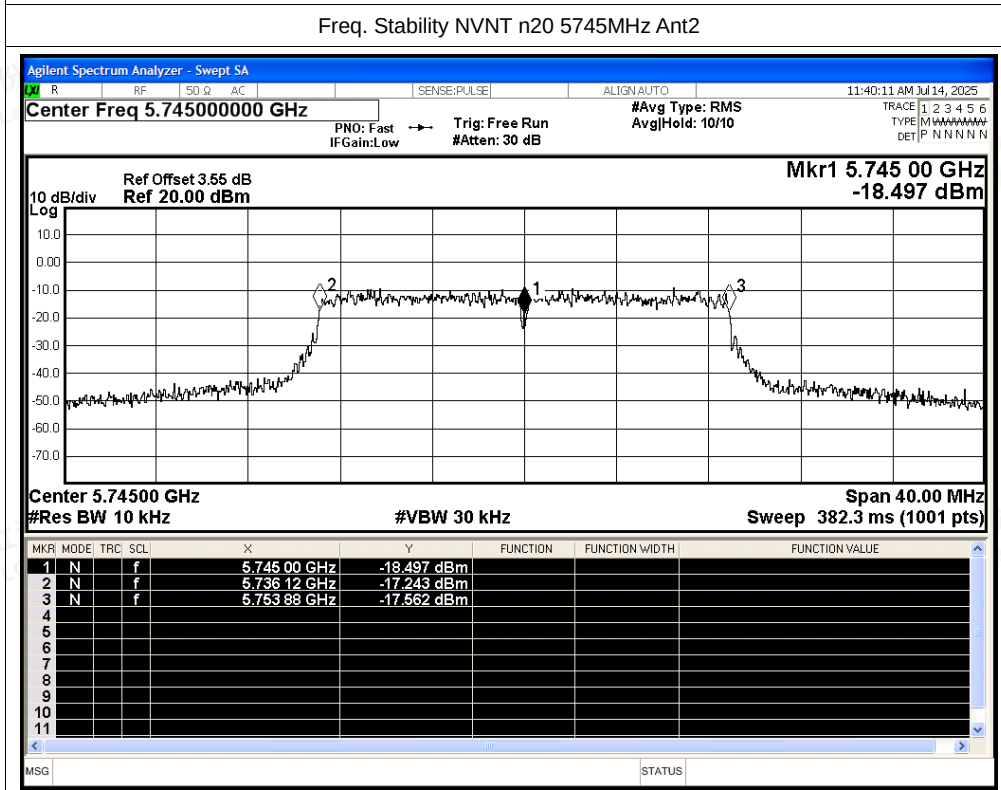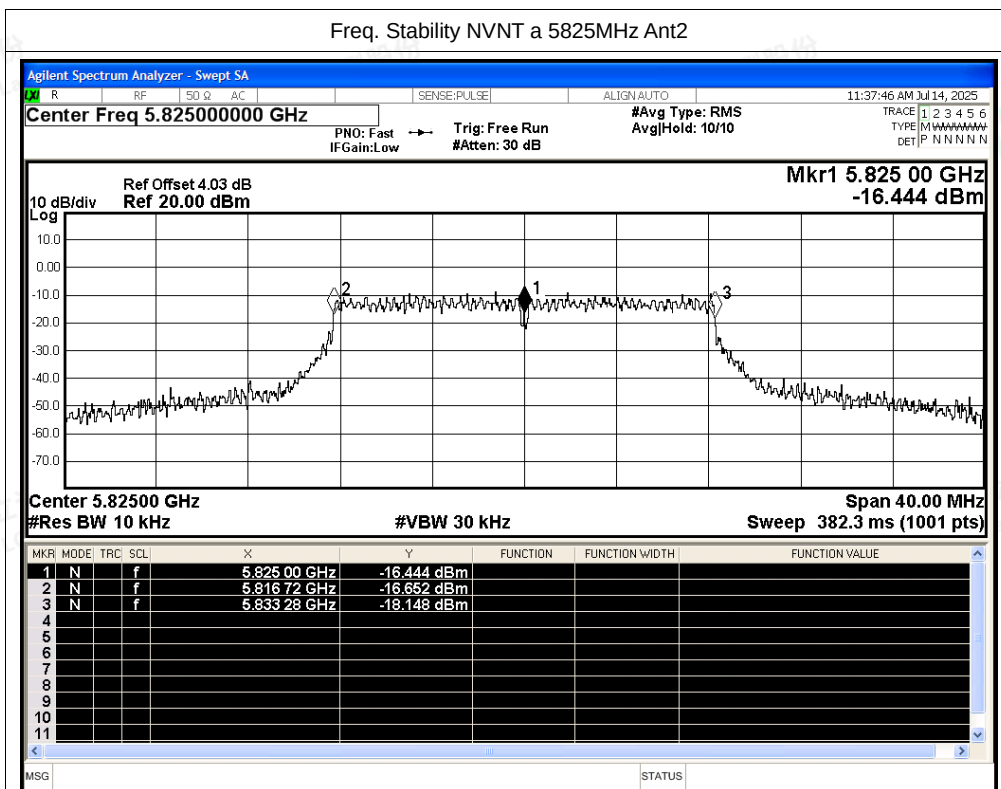

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant2

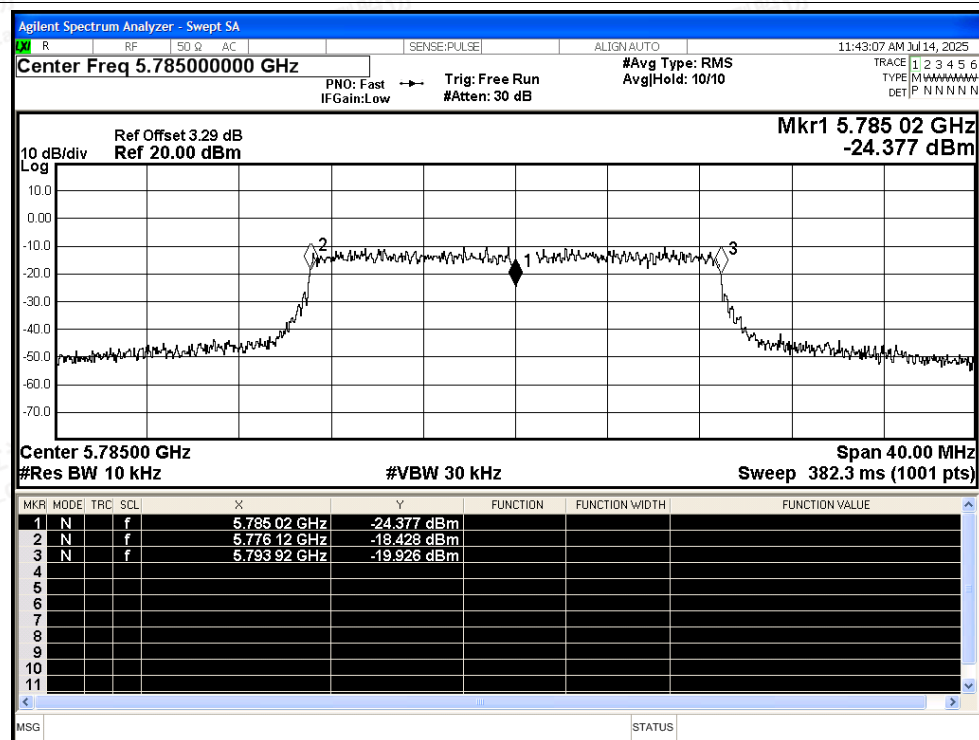

Freq. Stability NVNT n20 5825MHz Ant2

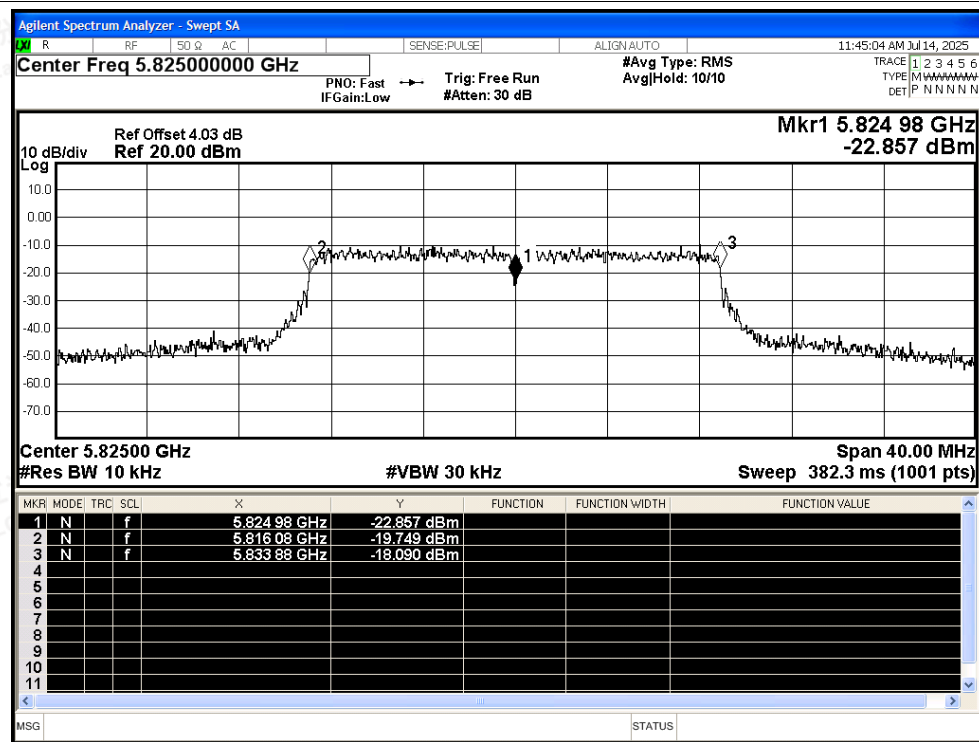

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant2

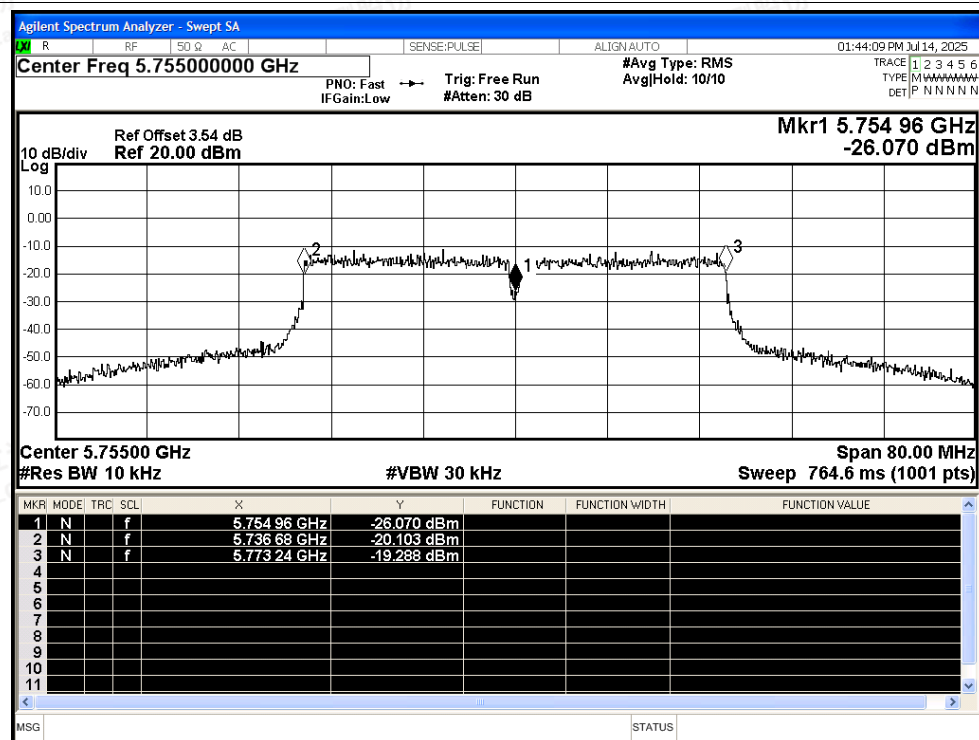

Freq. Stability NVNT n40 5795MHz Ant2


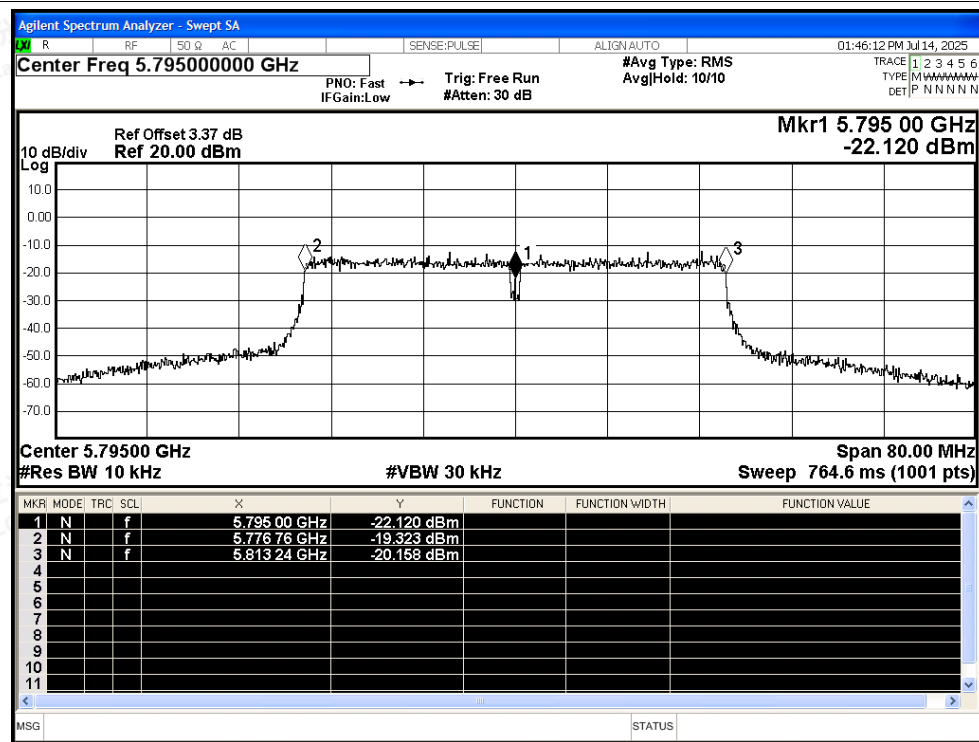


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

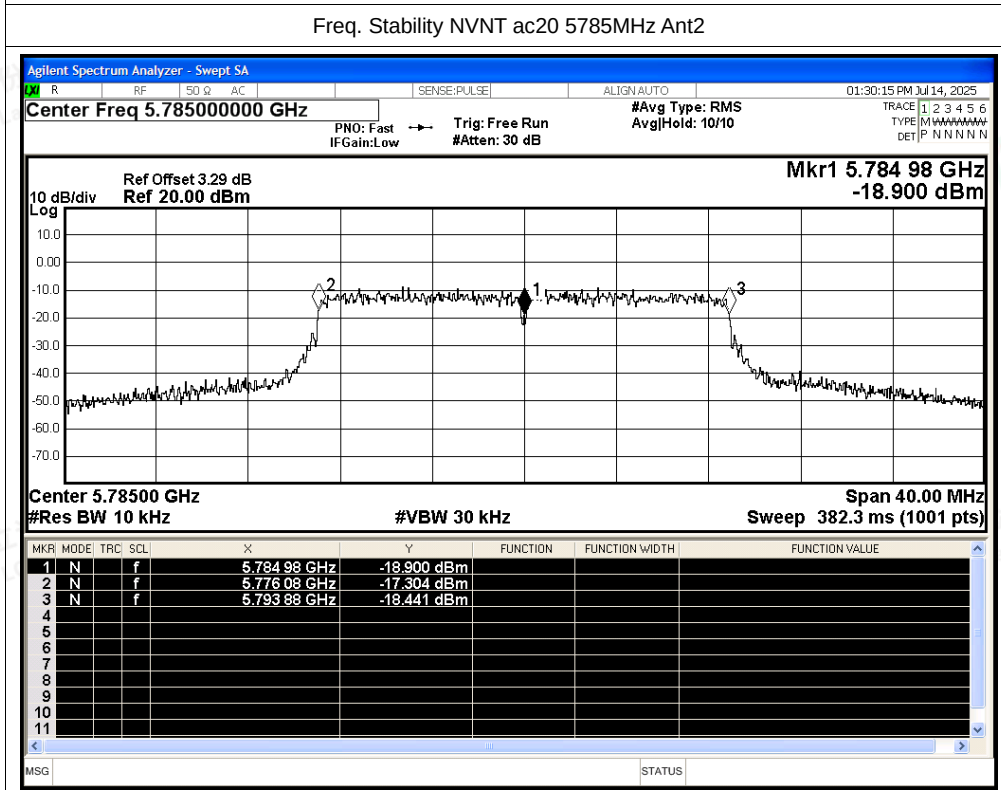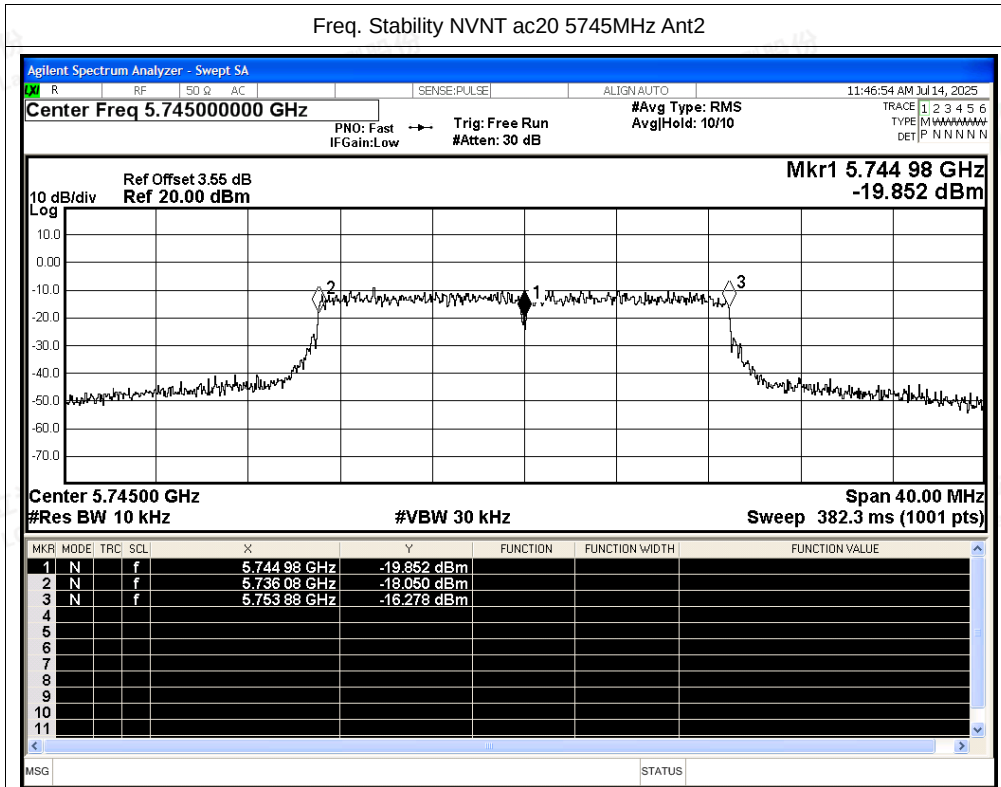

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant2

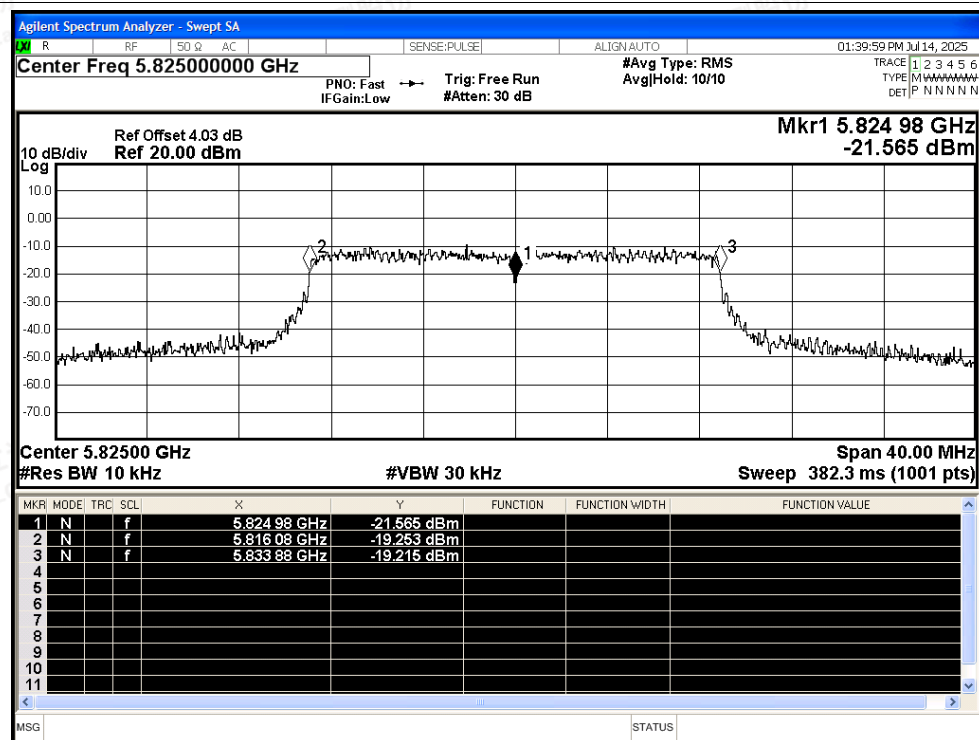

Freq. Stability NVNT ac40 5755MHz Ant2


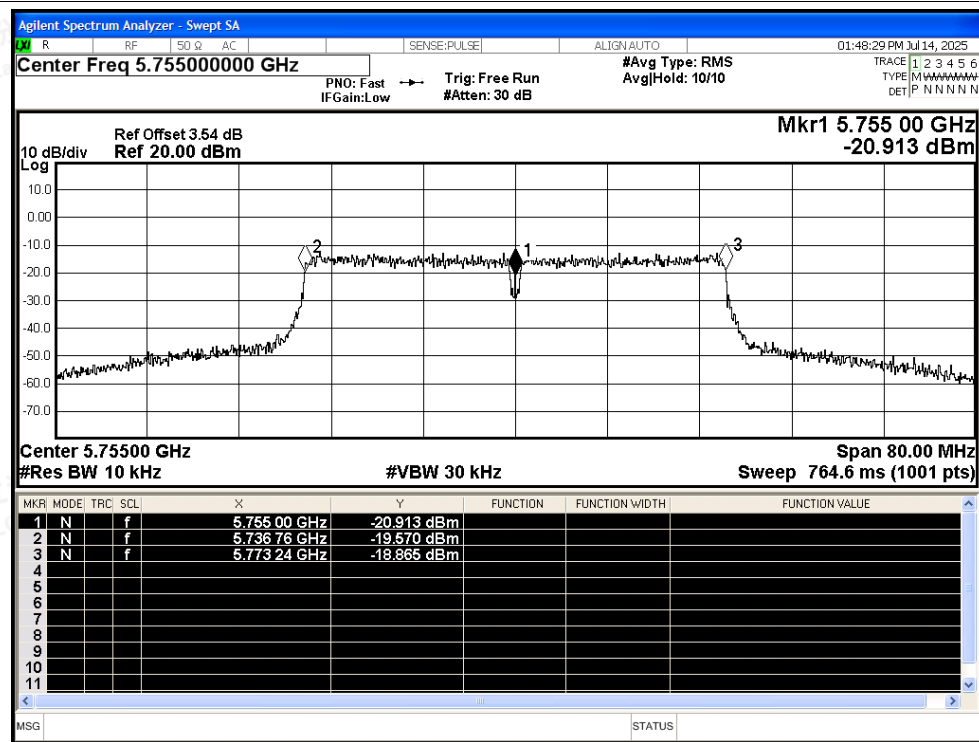


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

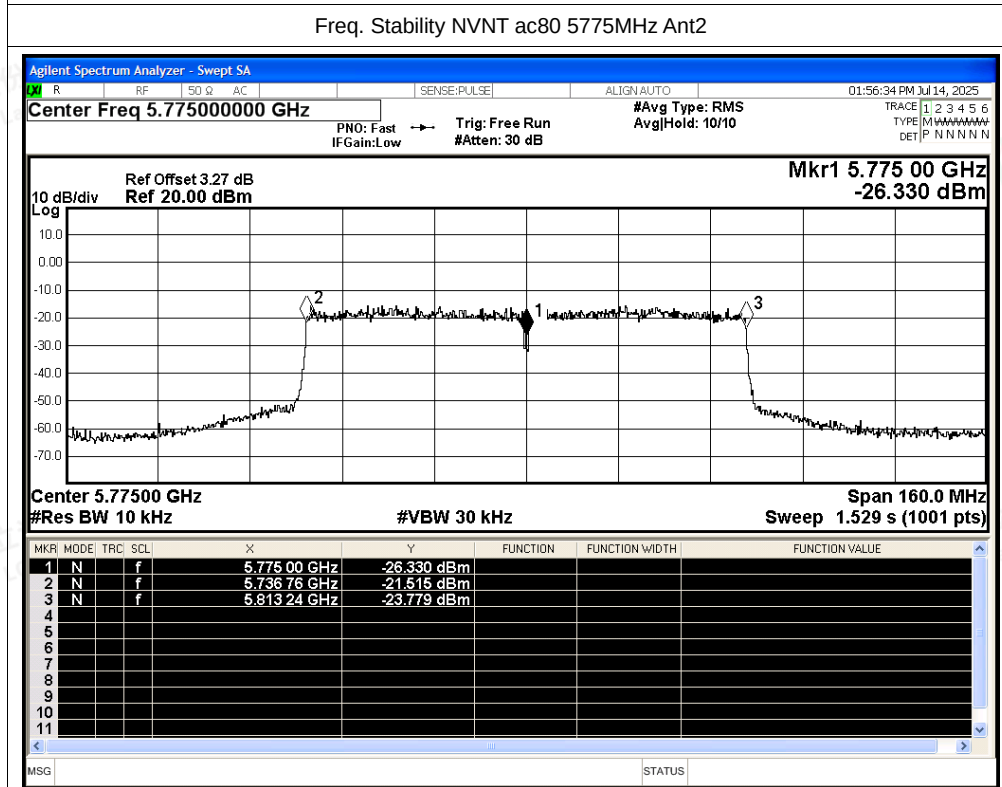
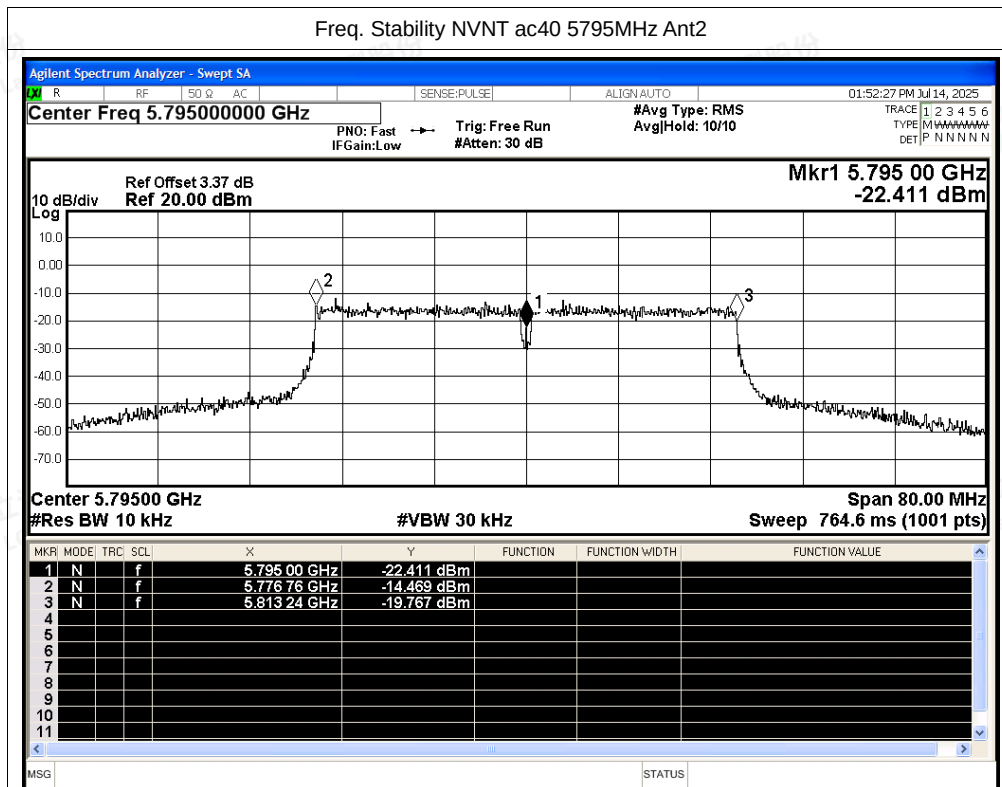


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

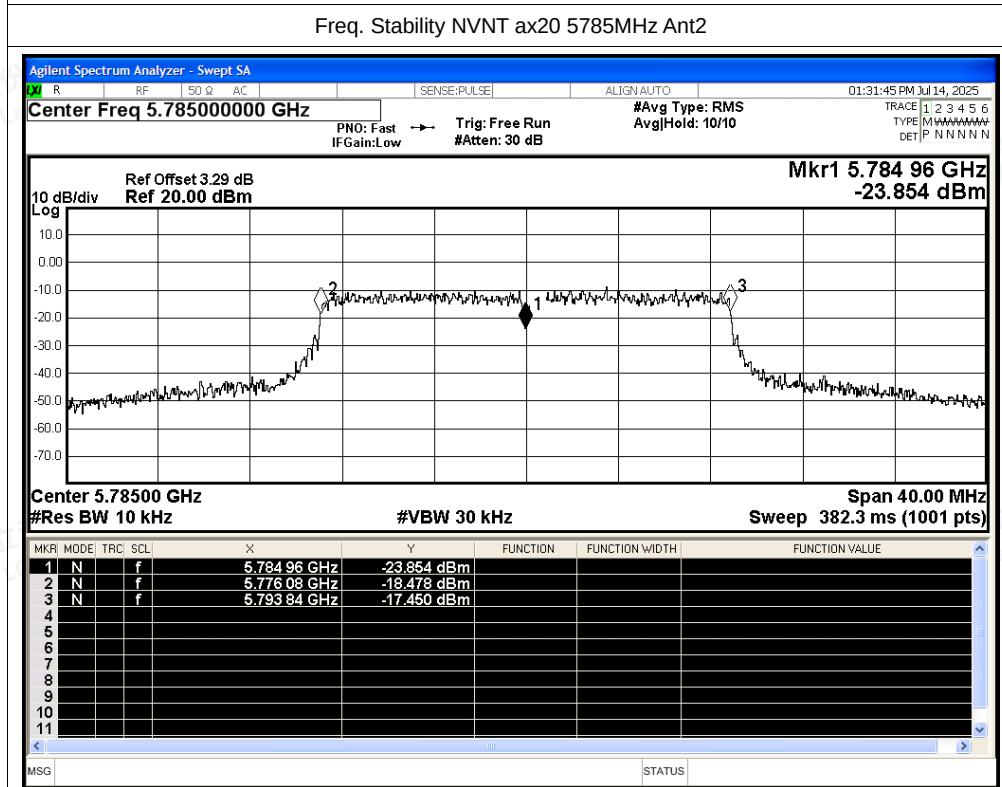
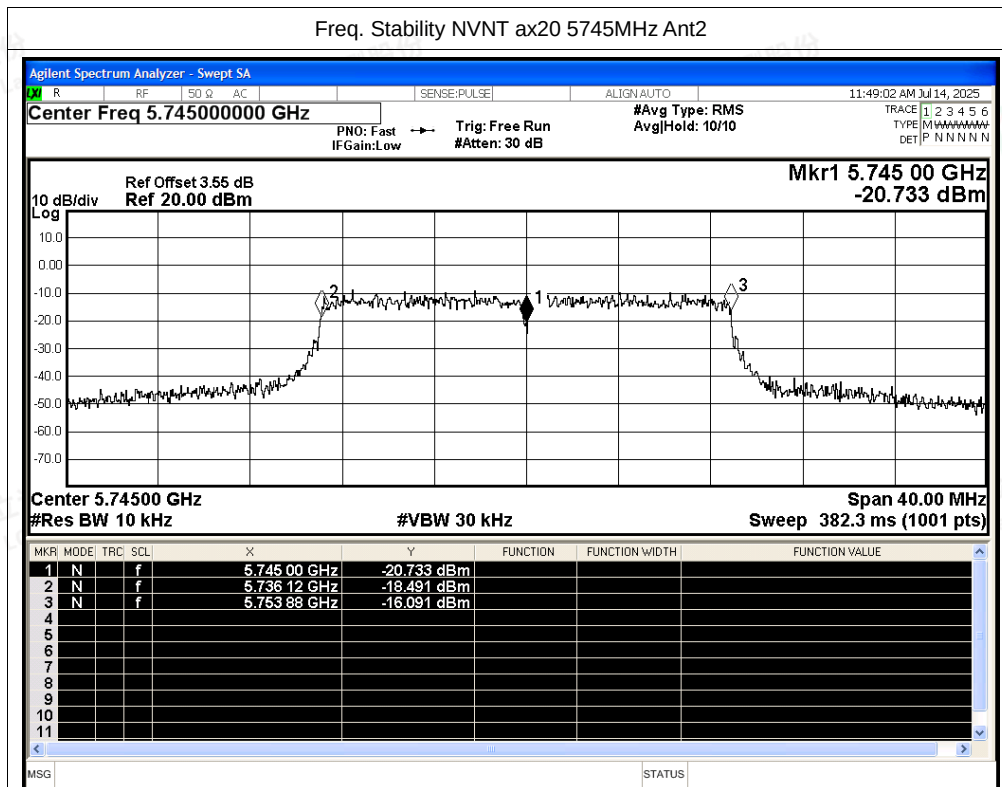


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

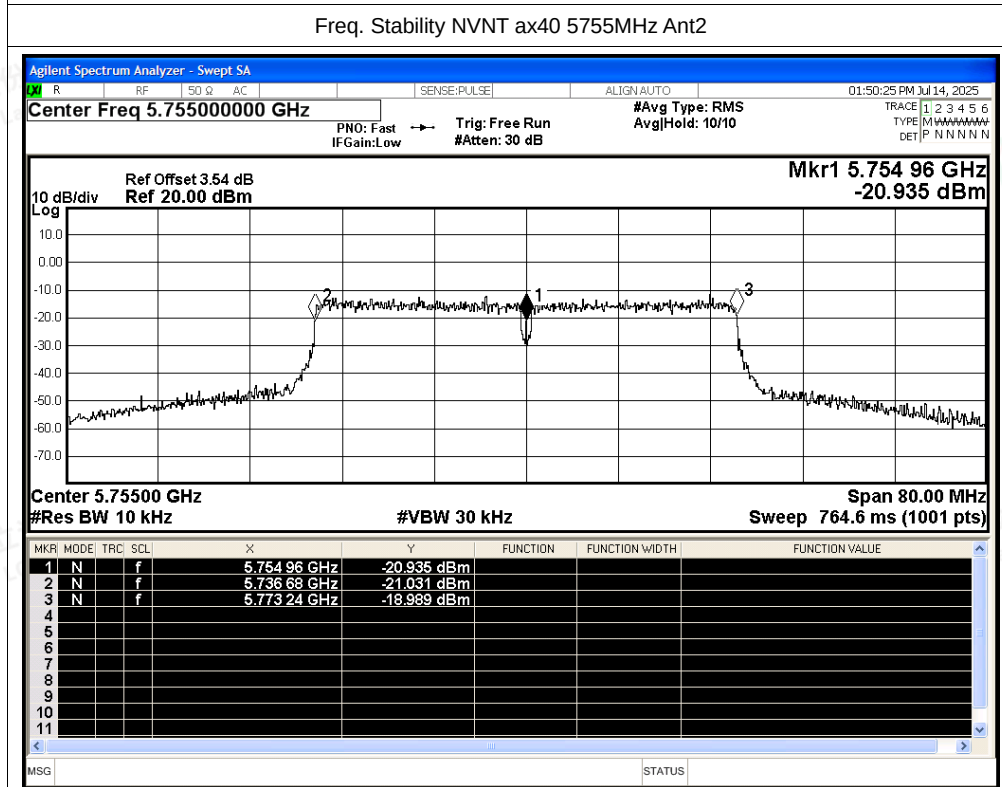
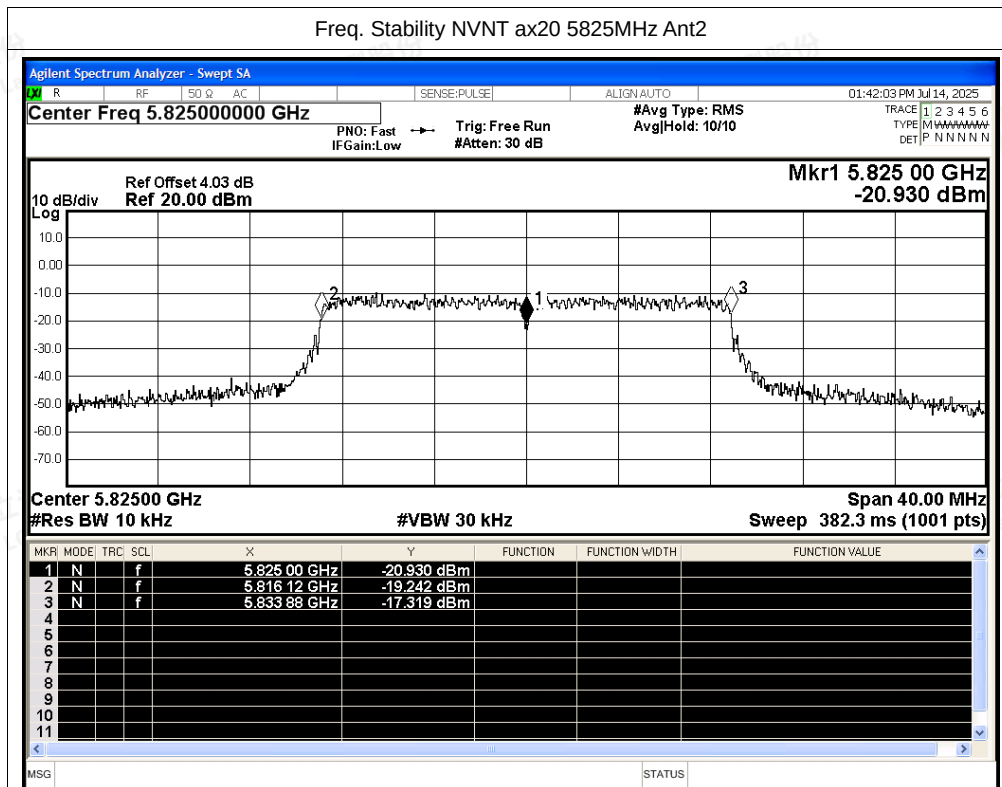


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

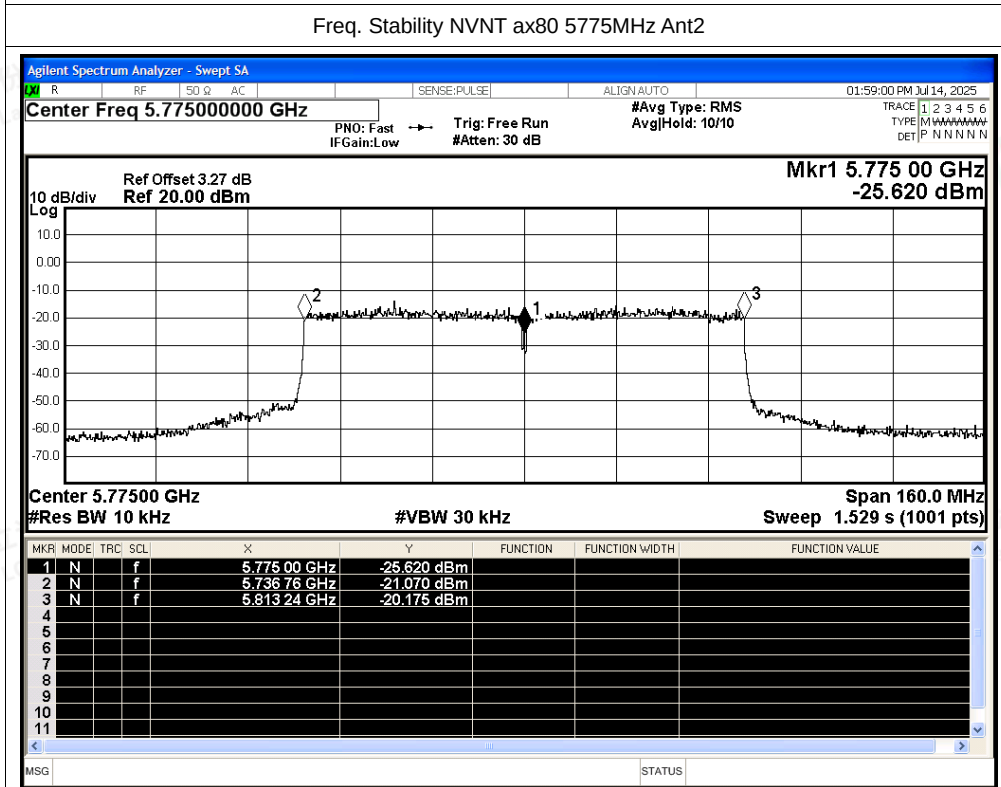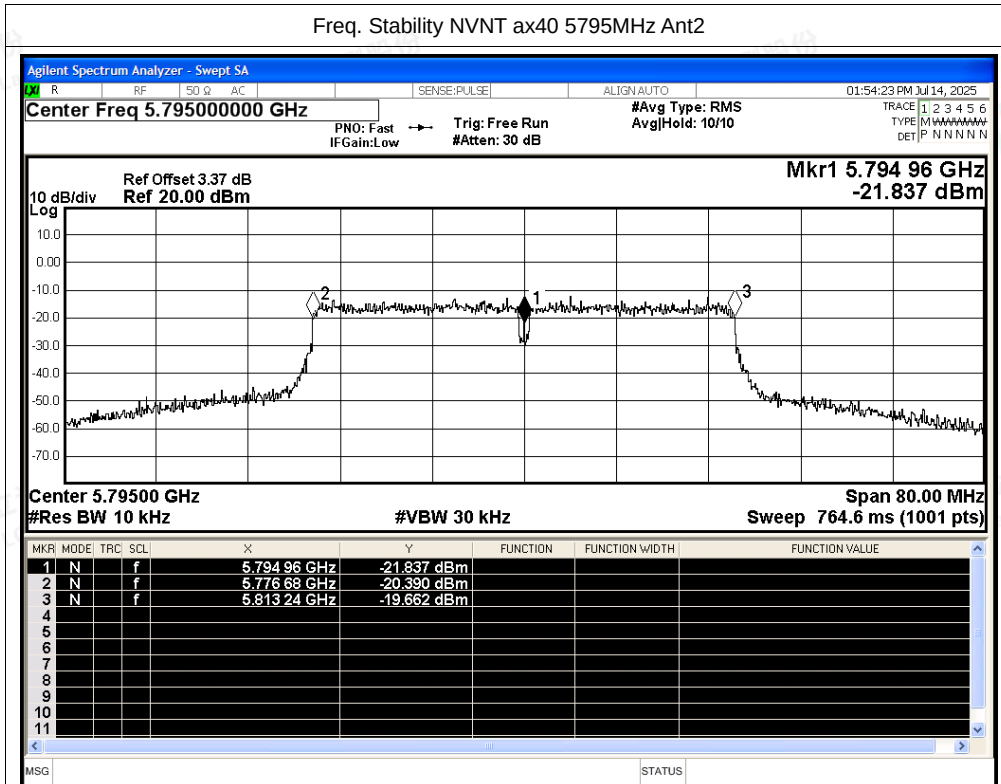

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant1	94.65	0.24	0.91
NVNT	a	5785	Ant1	94.65	0.24	0.91
NVNT	a	5825	Ant1	94.56	0.24	0.91
NVNT	n20	5745	Ant1	97.29	0.12	0.44
NVNT	n20	5785	Ant1	97.29	0.12	0.44
NVNT	n20	5825	Ant1	97.29	0.12	0.44
NVNT	n40	5755	Ant1	94.71	0.24	0.9
NVNT	n40	5795	Ant1	94.71	0.24	0.9
NVNT	ac20	5745	Ant1	97.34	0.12	0.44
NVNT	ac20	5785	Ant1	97.34	0.12	0.44
NVNT	ac20	5825	Ant1	97.34	0.12	0.44
NVNT	ac40	5755	Ant1	94.72	0.24	0.9
NVNT	ac40	5795	Ant1	94.72	0.24	0.9
NVNT	ac80	5775	Ant1	89.82	0.47	1.86
NVNT	ax20	5745	Ant1	97.3	0.12	0.44
NVNT	ax20	5785	Ant1	97.34	0.12	0.44
NVNT	ax20	5825	Ant1	97.34	0.12	0.44
NVNT	ax40	5755	Ant1	94.72	0.24	0.9
NVNT	ax40	5795	Ant1	94.72	0.24	0.9
NVNT	ax80	5775	Ant1	89.65	0.47	1.86



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5745MHz Ant1

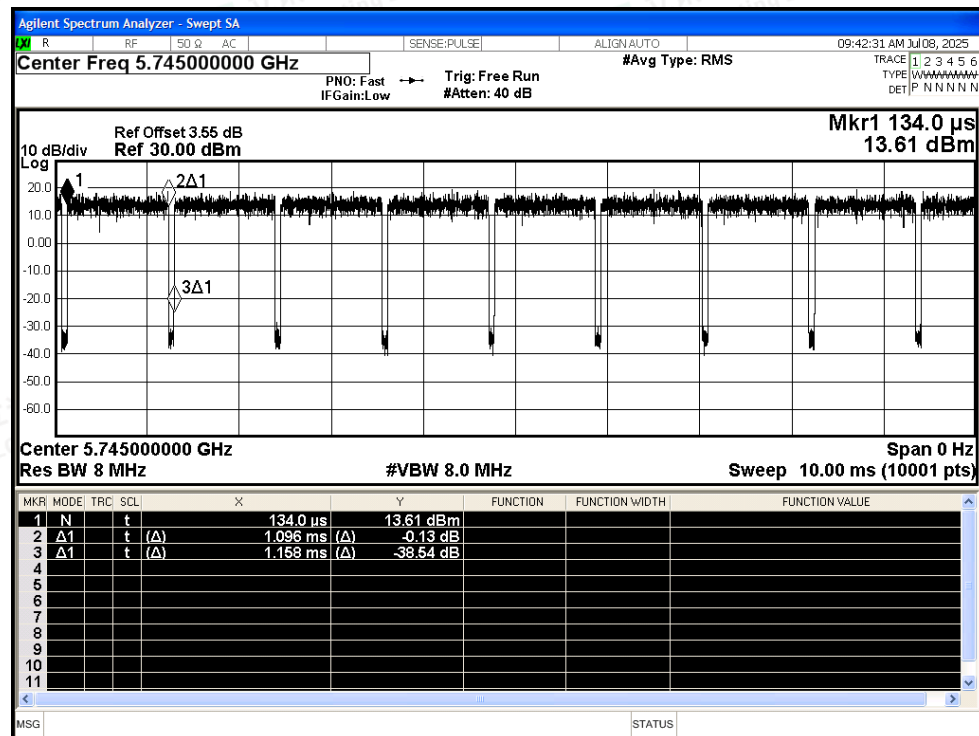

Duty Cycle NVNT a 5785MHz Ant1


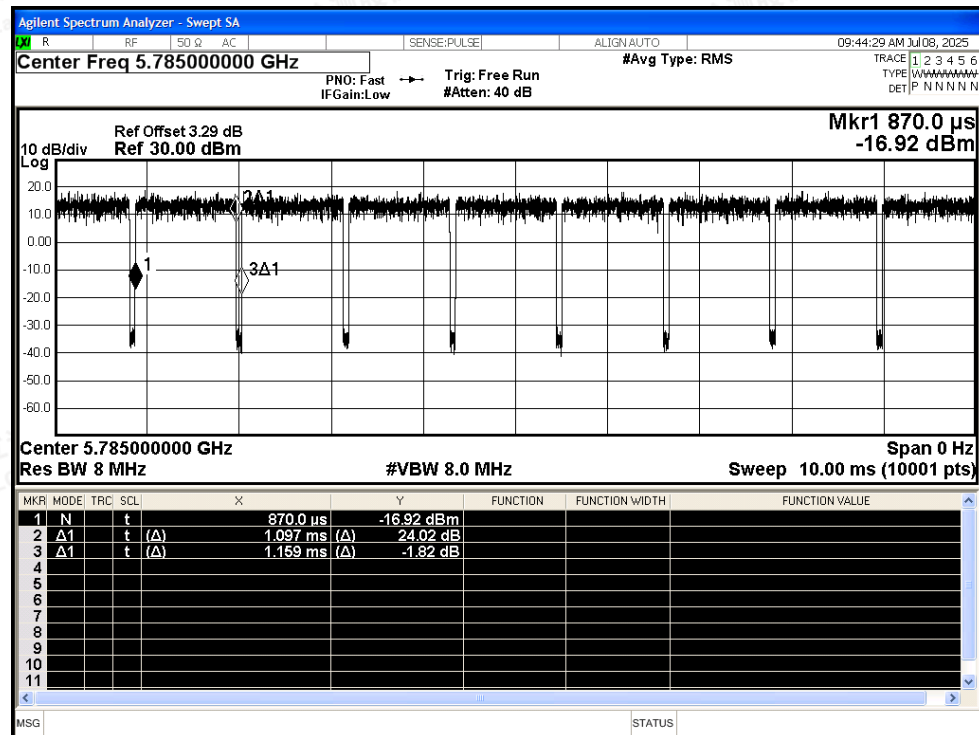


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

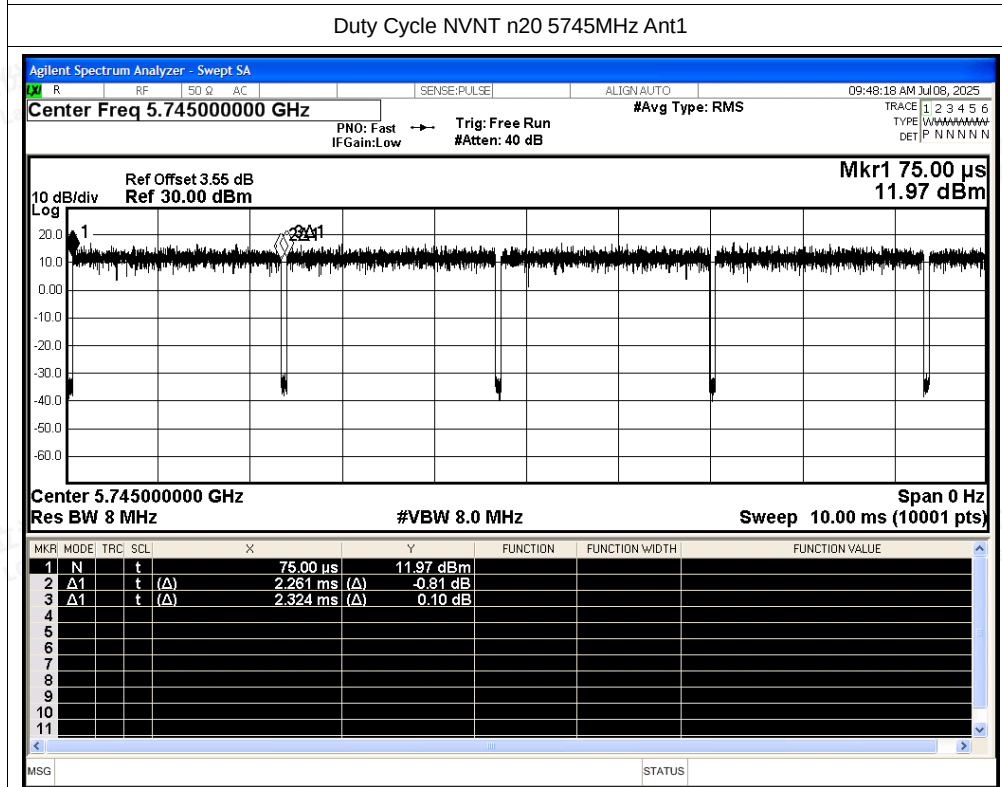
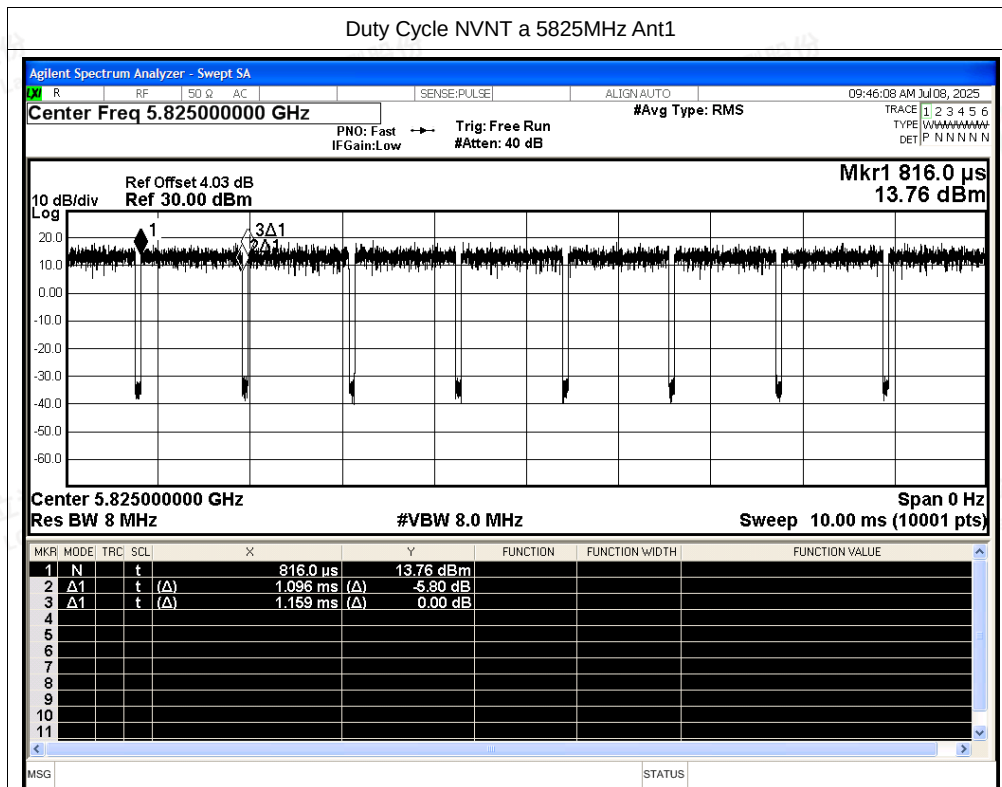


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

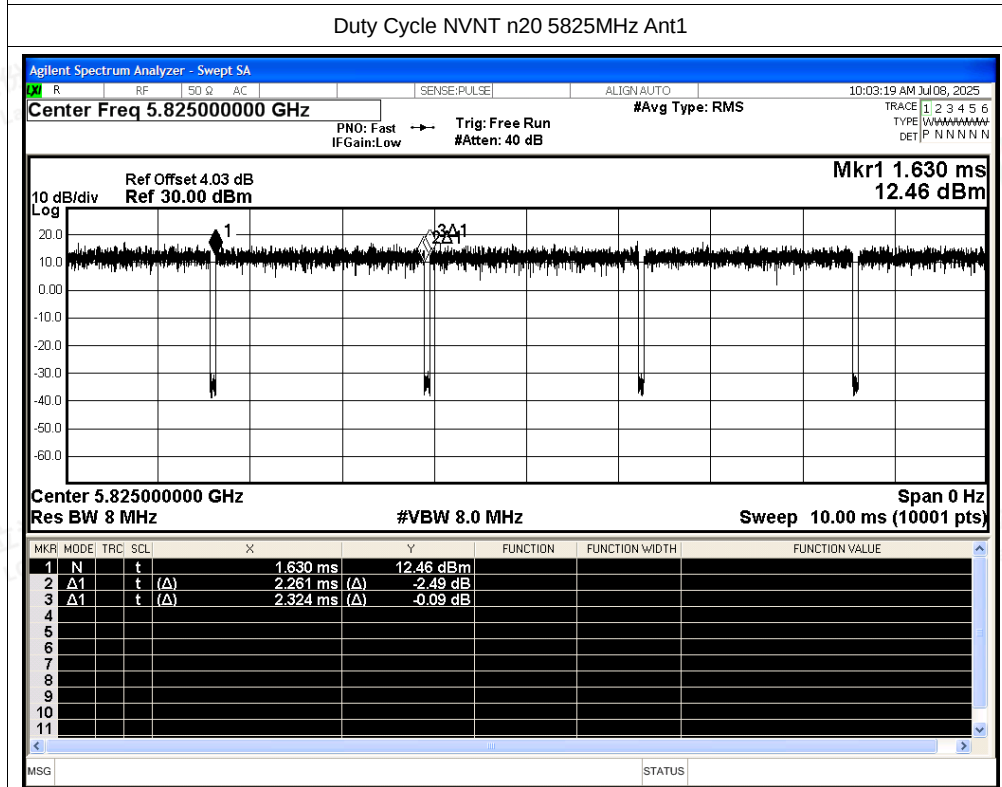
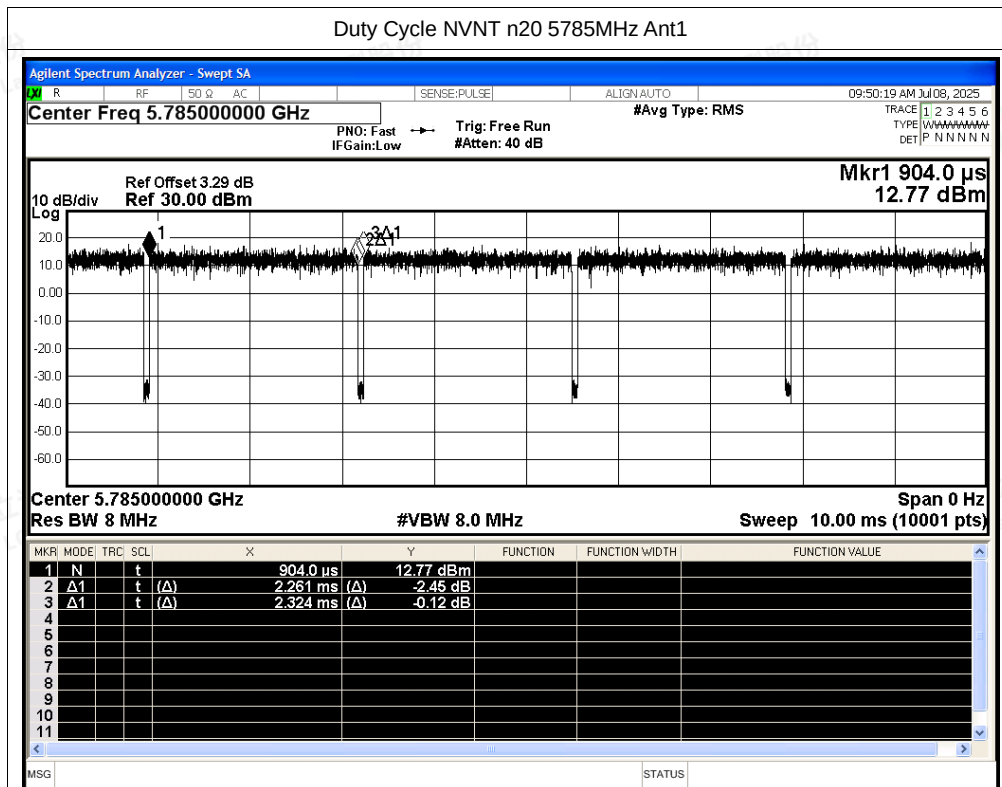


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

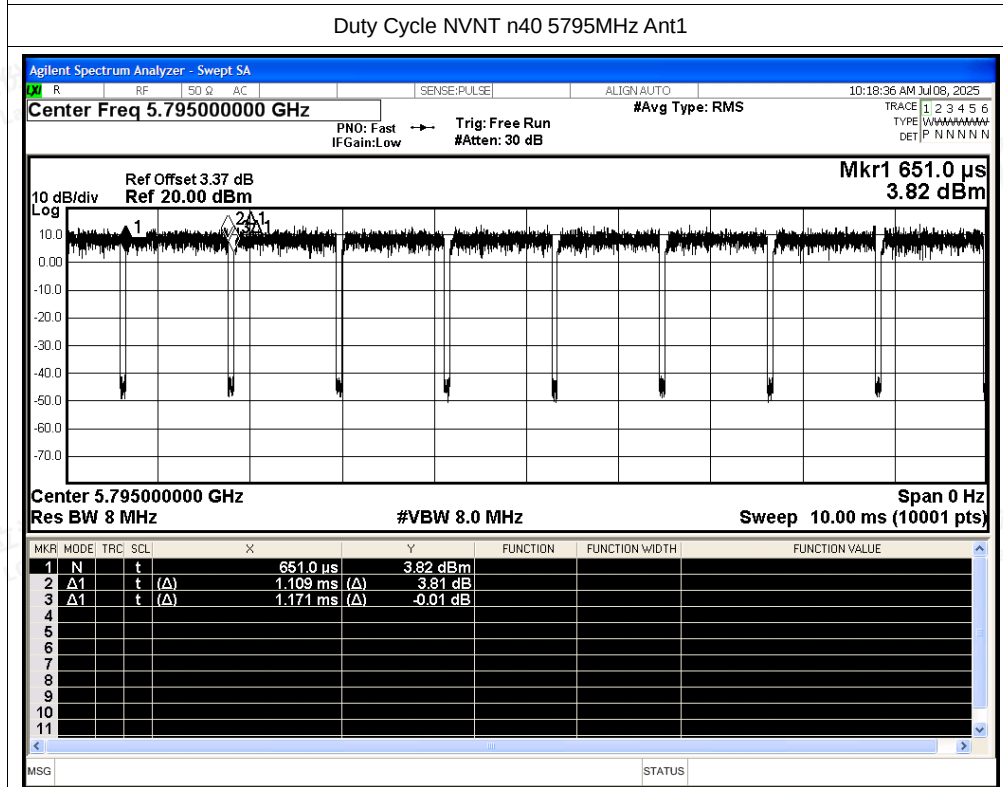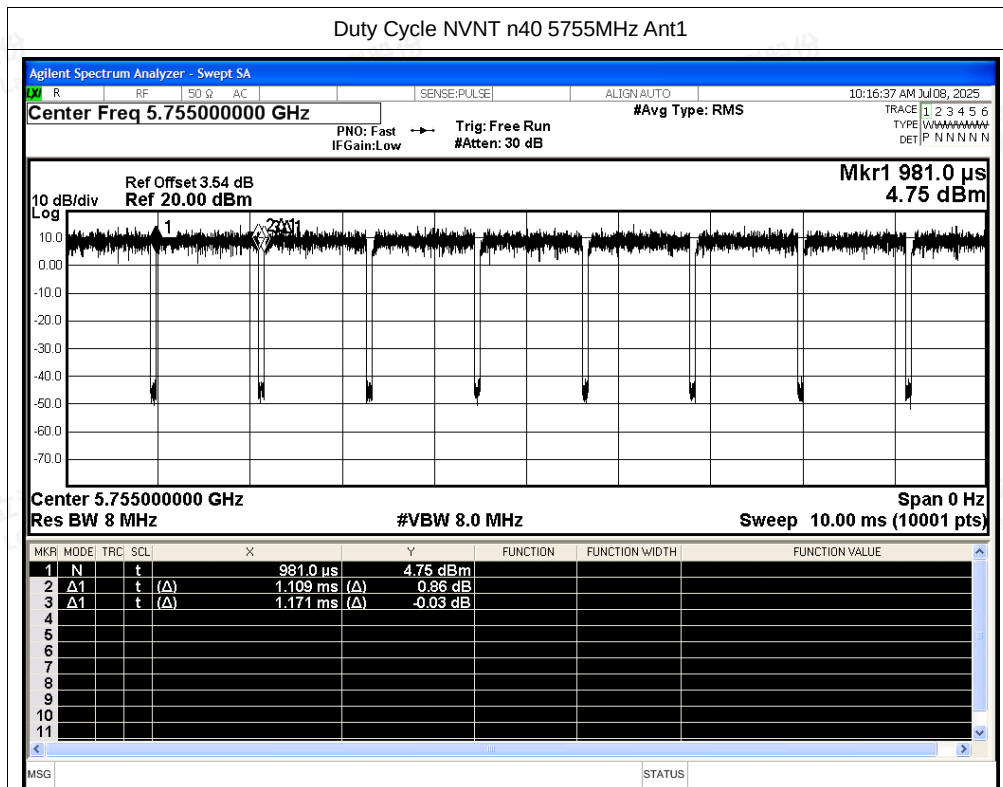

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5745MHz Ant1

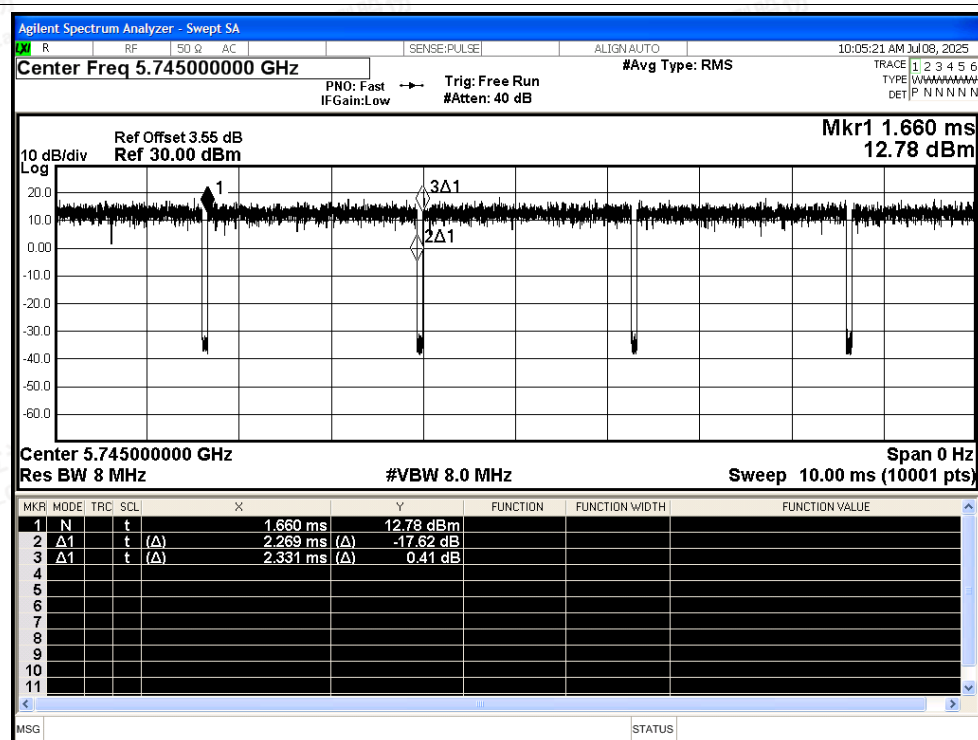

Duty Cycle NVNT ac20 5785MHz Ant1


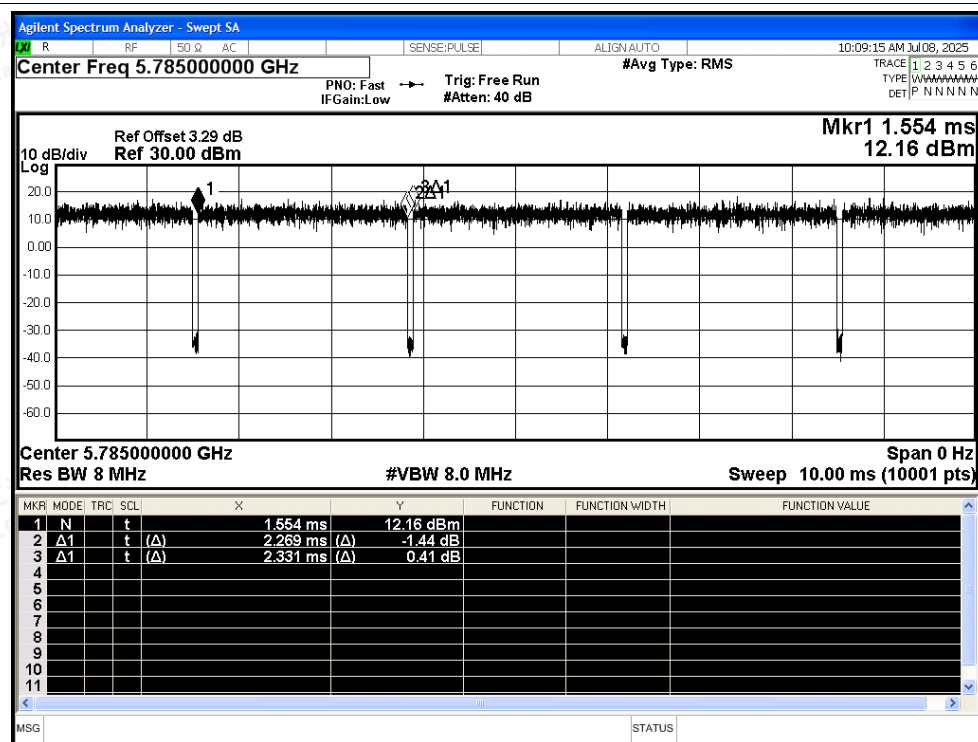


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

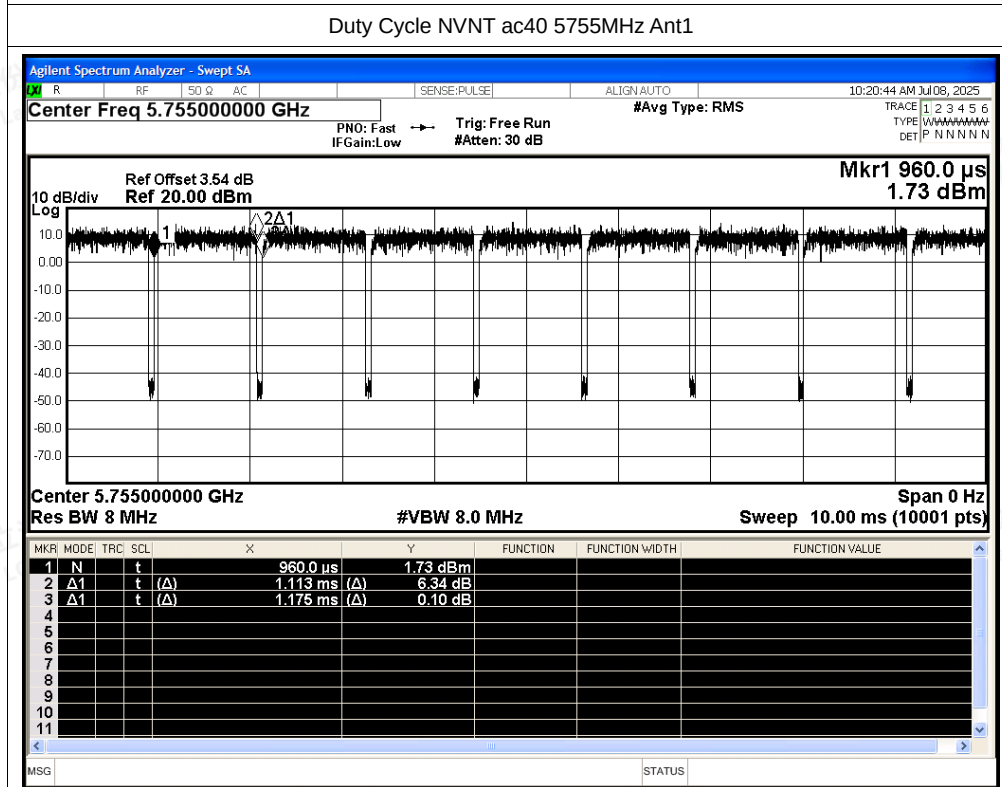
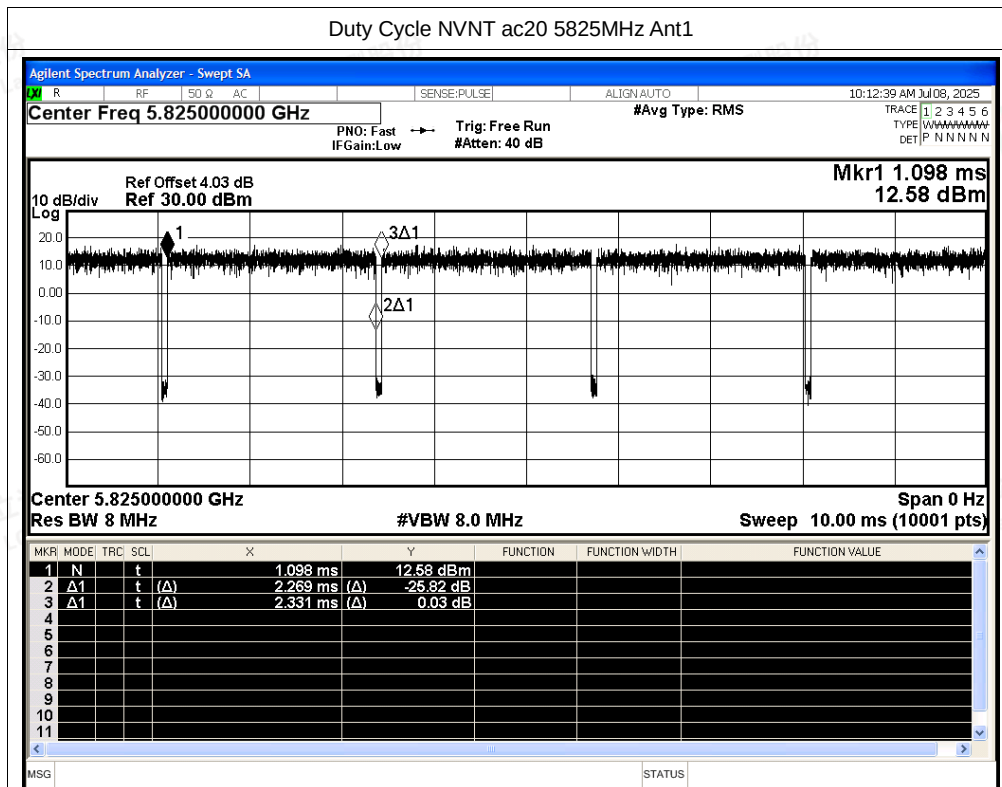


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

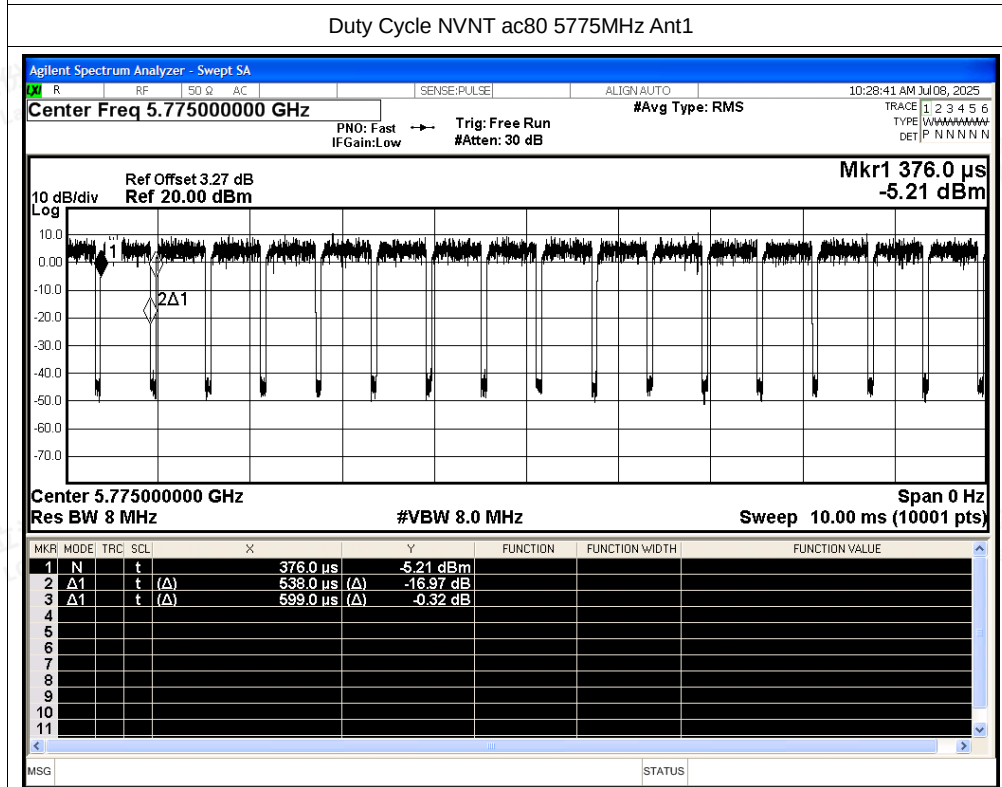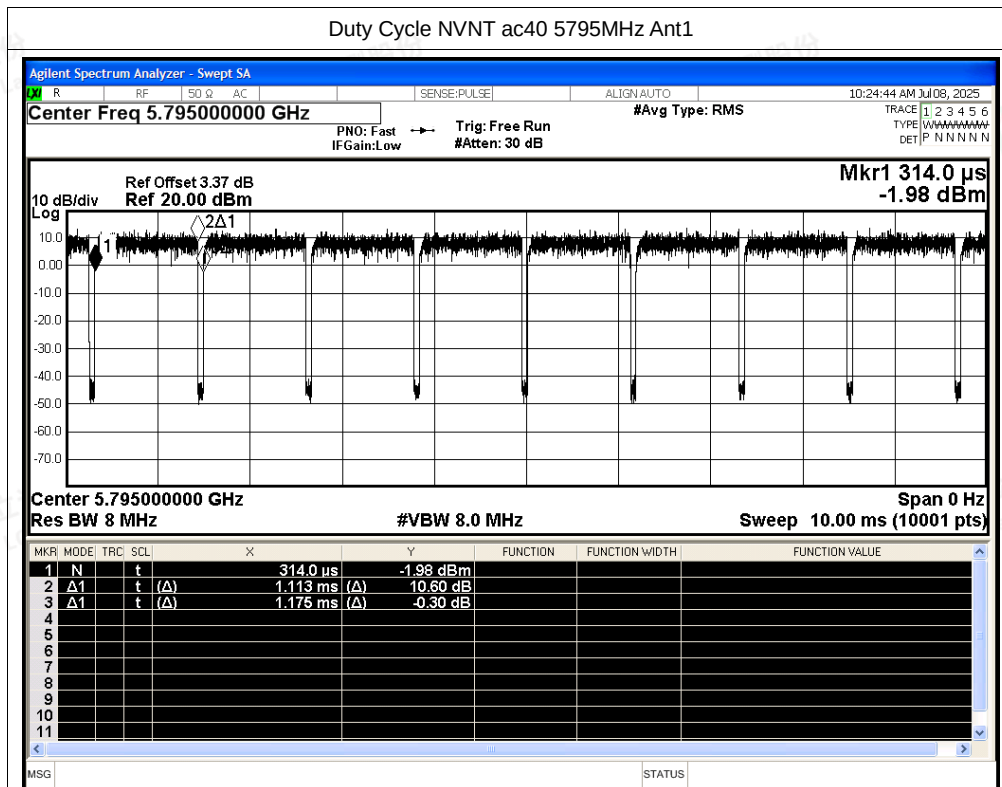

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5745MHz Ant1

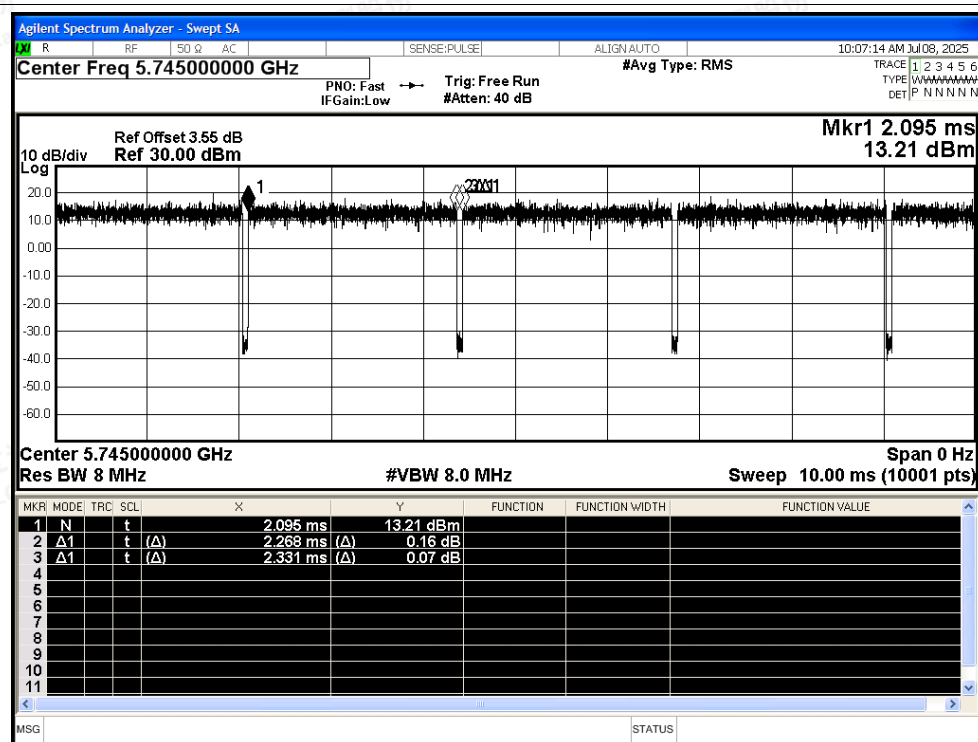

Duty Cycle NVNT ax20 5785MHz Ant1

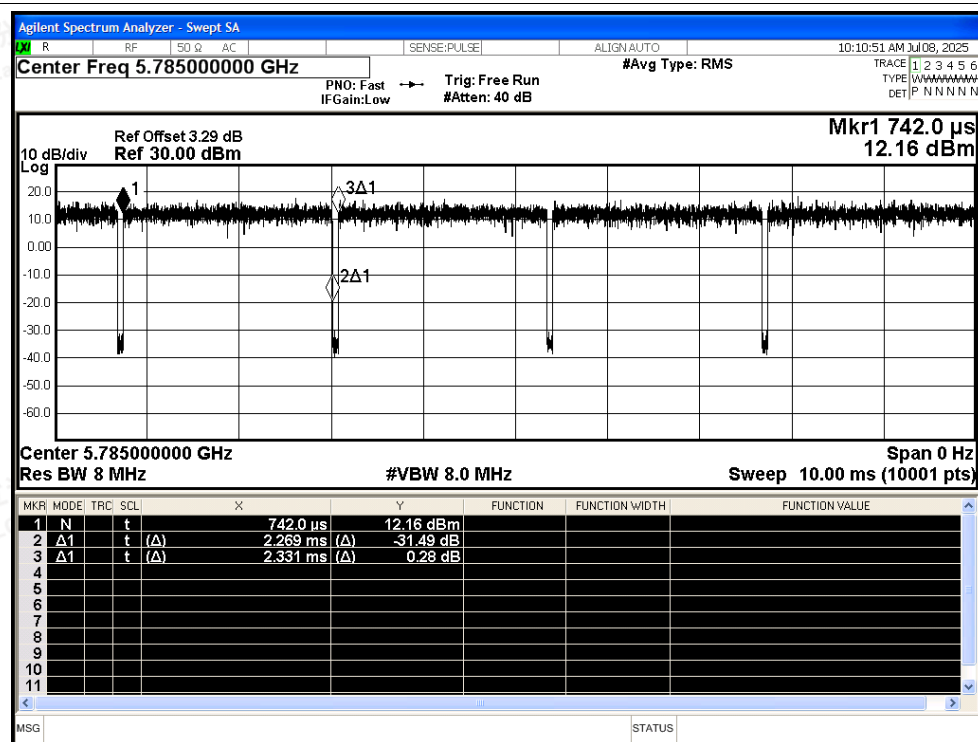

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant1

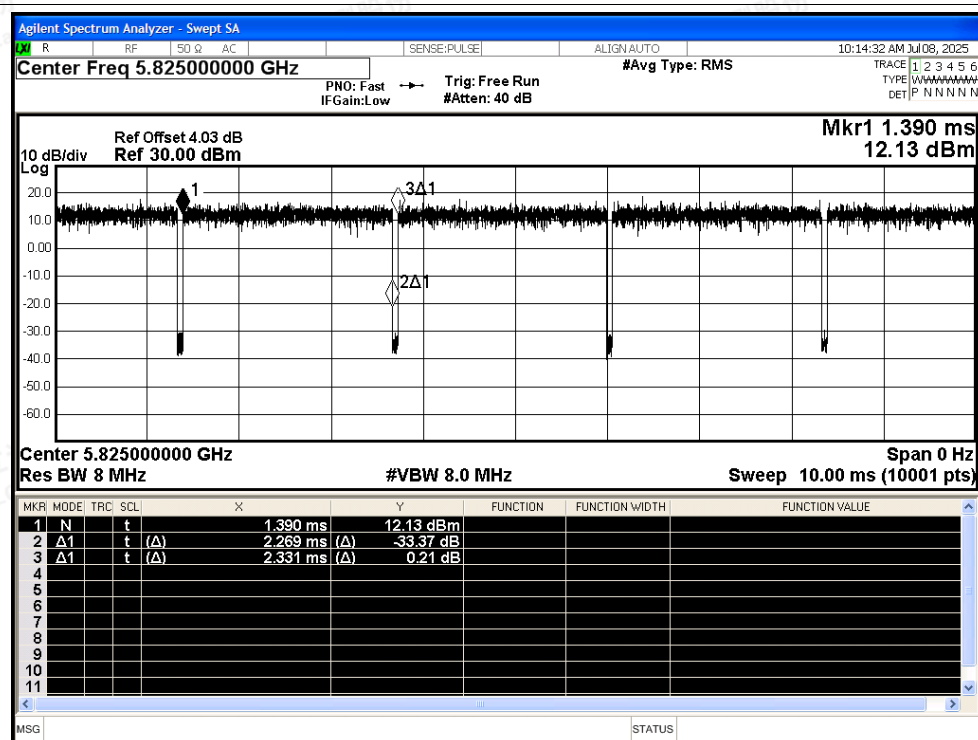

Duty Cycle NVNT ax40 5755MHz Ant1

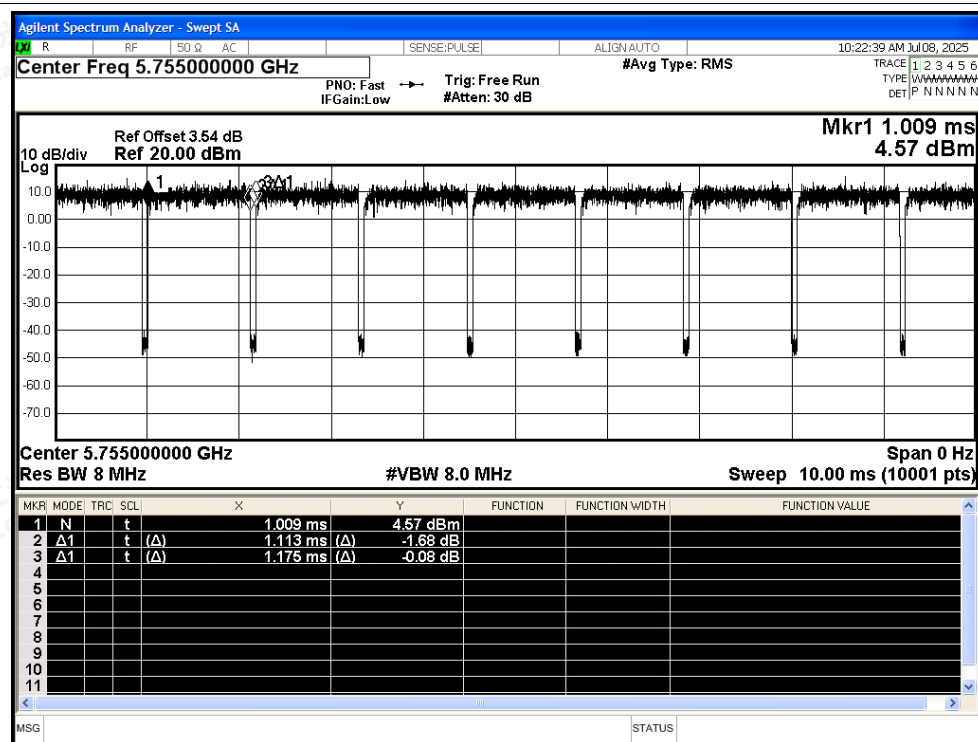

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5795MHz Ant1

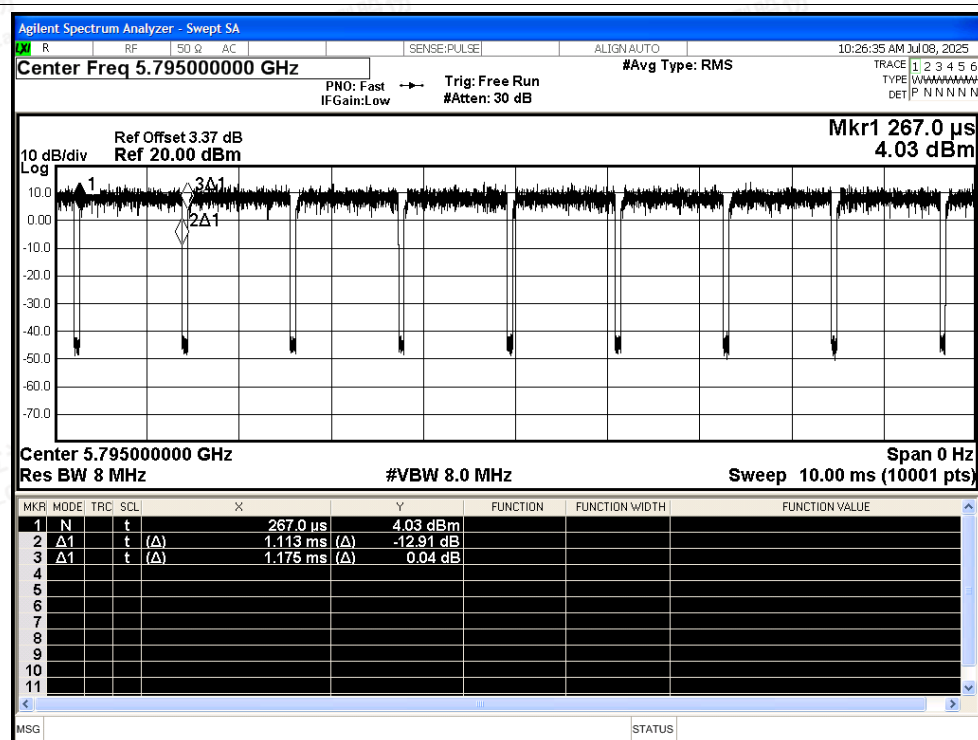

Duty Cycle NVNT ax80 5775MHz Ant1

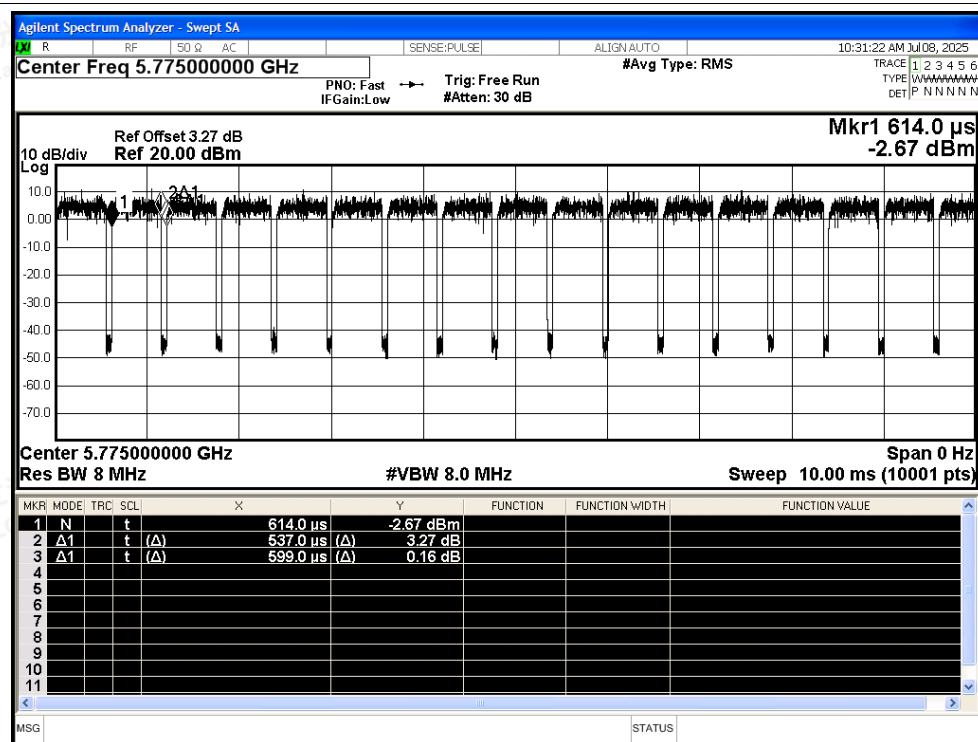

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5745	Ant2	94.56	0.24	0.91
NVNT	a	5785	Ant2	94.56	0.24	0.91
NVNT	a	5825	Ant2	94.56	0.24	0.91
NVNT	n20	5745	Ant2	97.29	0.12	0.44
NVNT	n20	5785	Ant2	97.29	0.12	0.44
NVNT	n20	5825	Ant2	97.29	0.12	0.44
NVNT	n40	5755	Ant2	94.71	0.24	0.9
NVNT	n40	5795	Ant2	94.71	0.24	0.9
NVNT	ac20	5745	Ant2	97.3	0.12	0.44
NVNT	ac20	5785	Ant2	97.34	0.12	0.44
NVNT	ac20	5825	Ant2	97.34	0.12	0.44
NVNT	ac40	5755	Ant2	94.72	0.24	0.9
NVNT	ac40	5795	Ant2	94.72	0.24	0.9
NVNT	ac80	5775	Ant2	89.65	0.47	1.86
NVNT	ax20	5745	Ant2	97.34	0.12	0.44
NVNT	ax20	5785	Ant2	97.34	0.12	0.44
NVNT	ax20	5825	Ant2	97.34	0.12	0.44
NVNT	ax40	5755	Ant2	94.72	0.24	0.9
NVNT	ax40	5795	Ant2	94.81	0.23	0.9
NVNT	ax80	5775	Ant2	89.82	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5745MHz Ant2

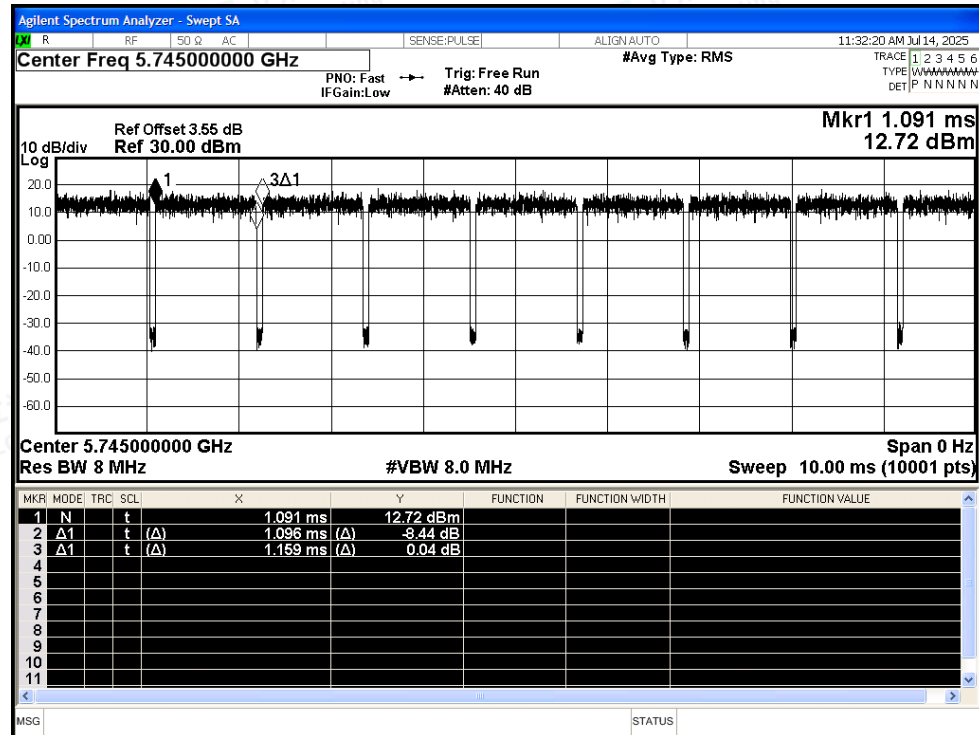

Duty Cycle NVNT a 5785MHz Ant2

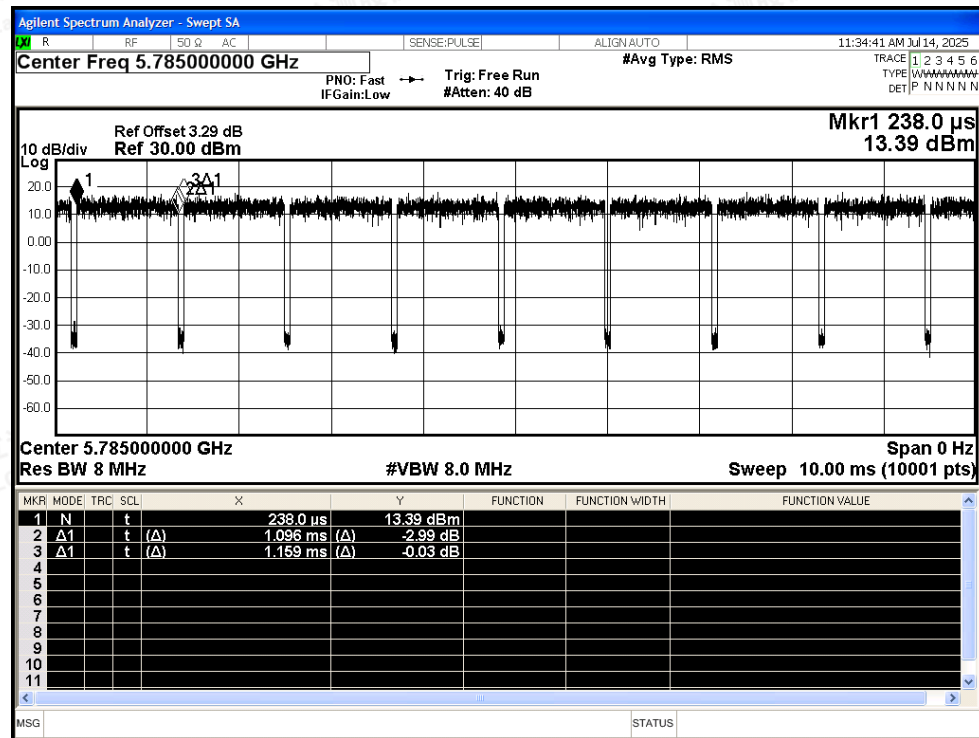

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5825MHz Ant2

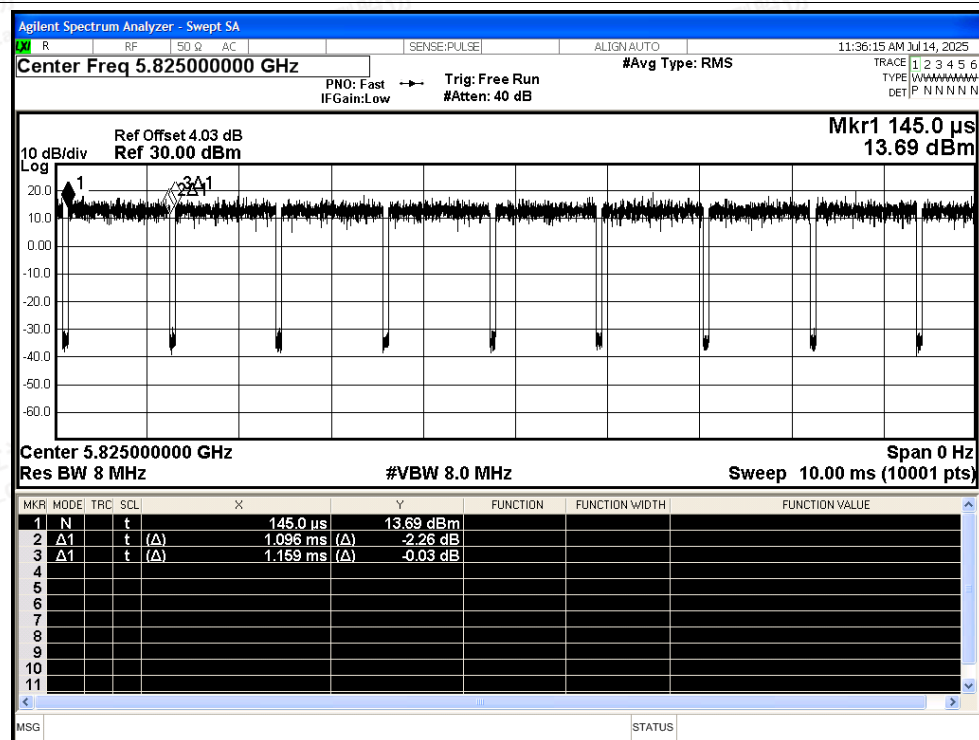

Duty Cycle NVNT n20 5745MHz Ant2


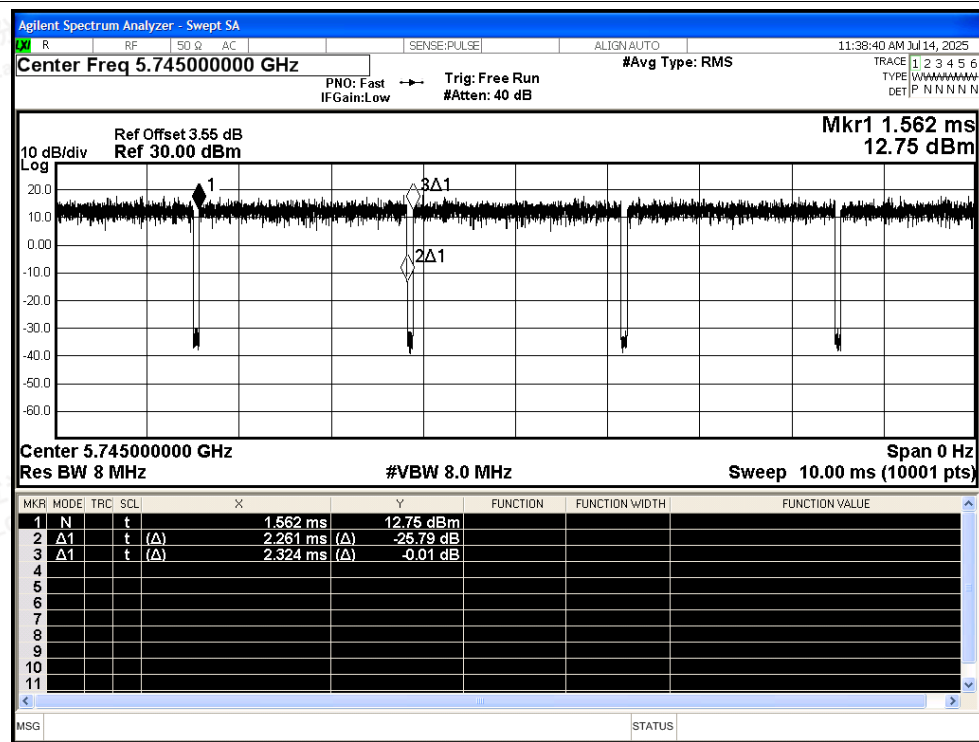


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

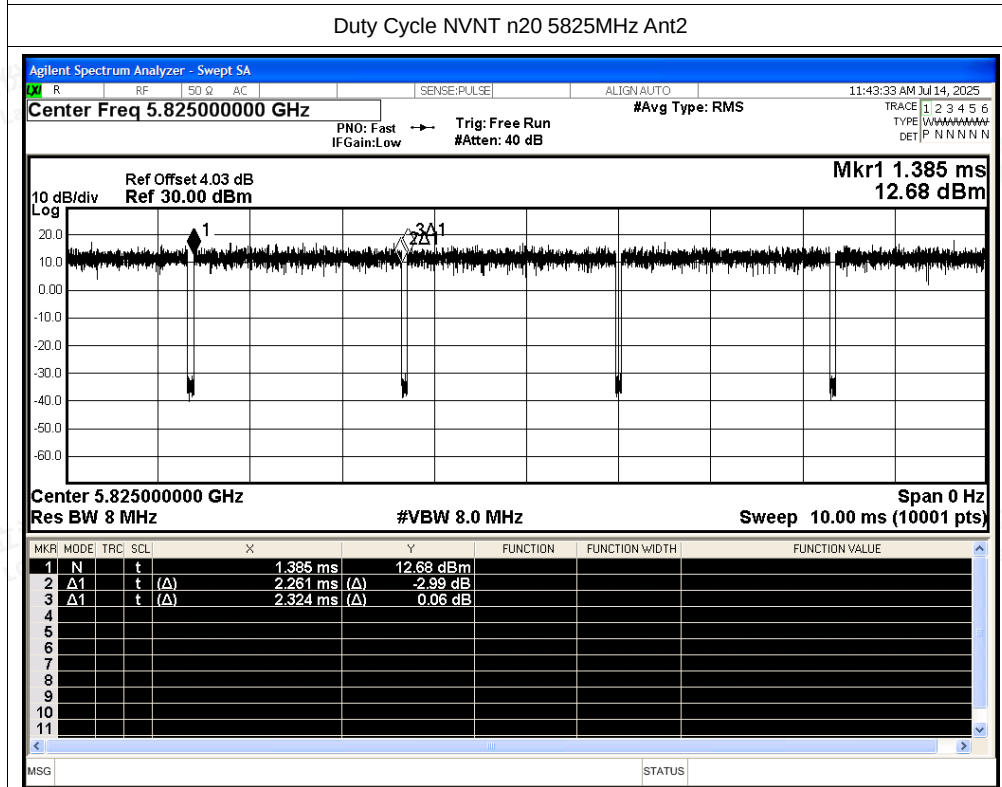
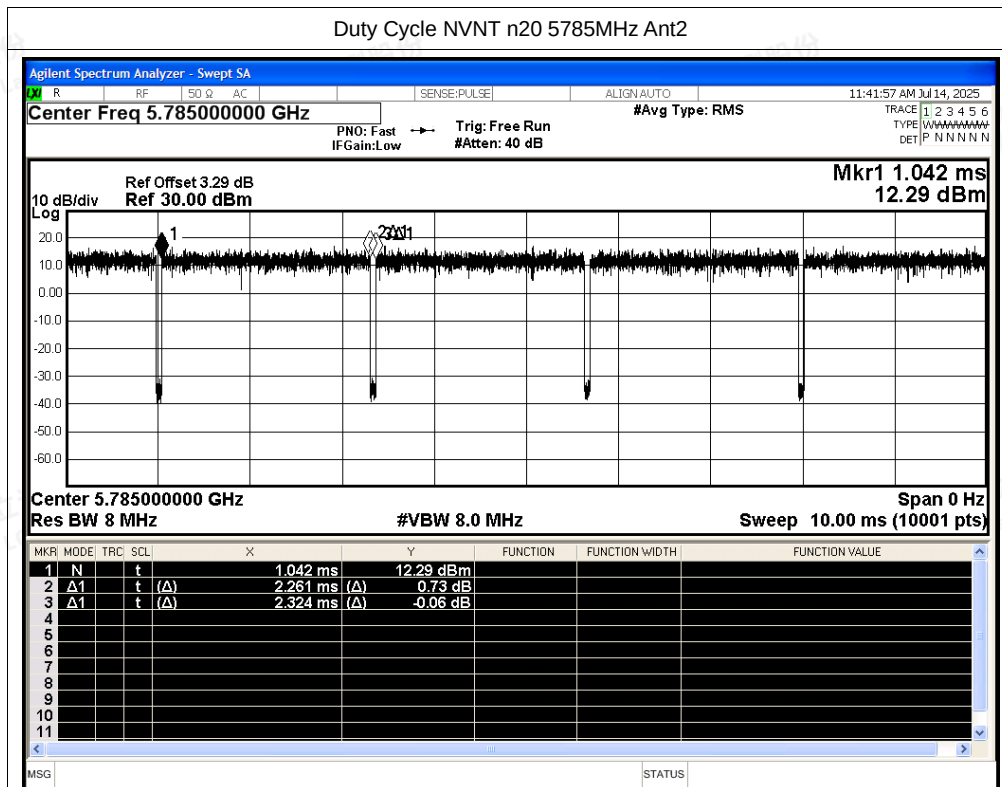


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

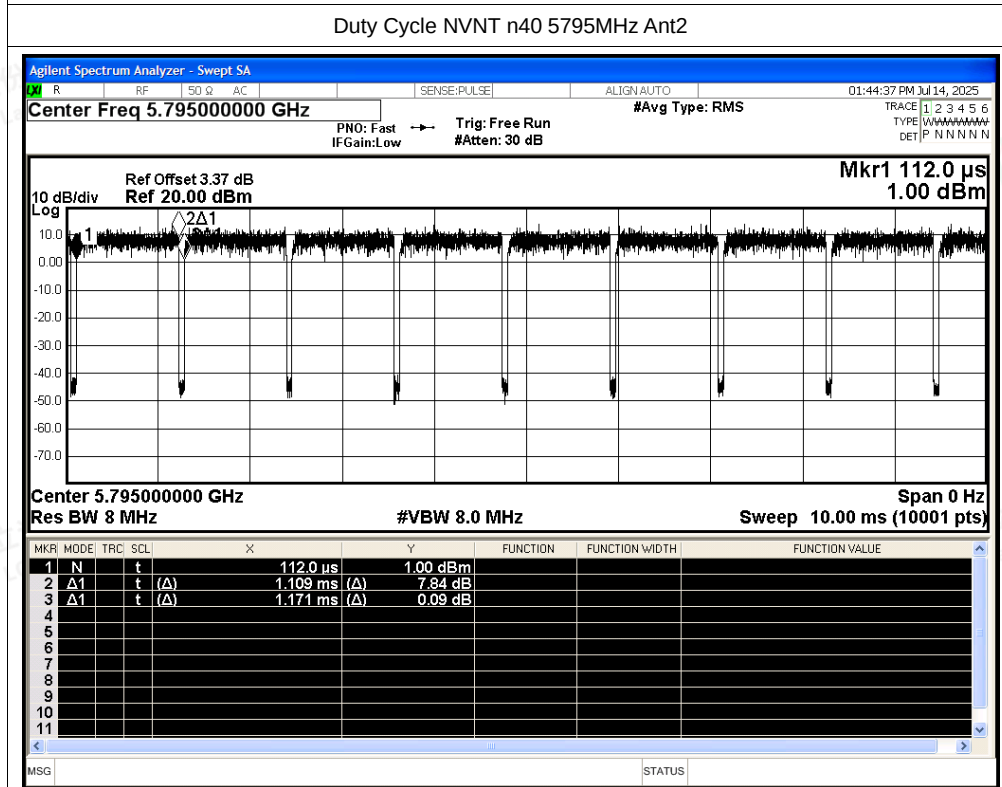
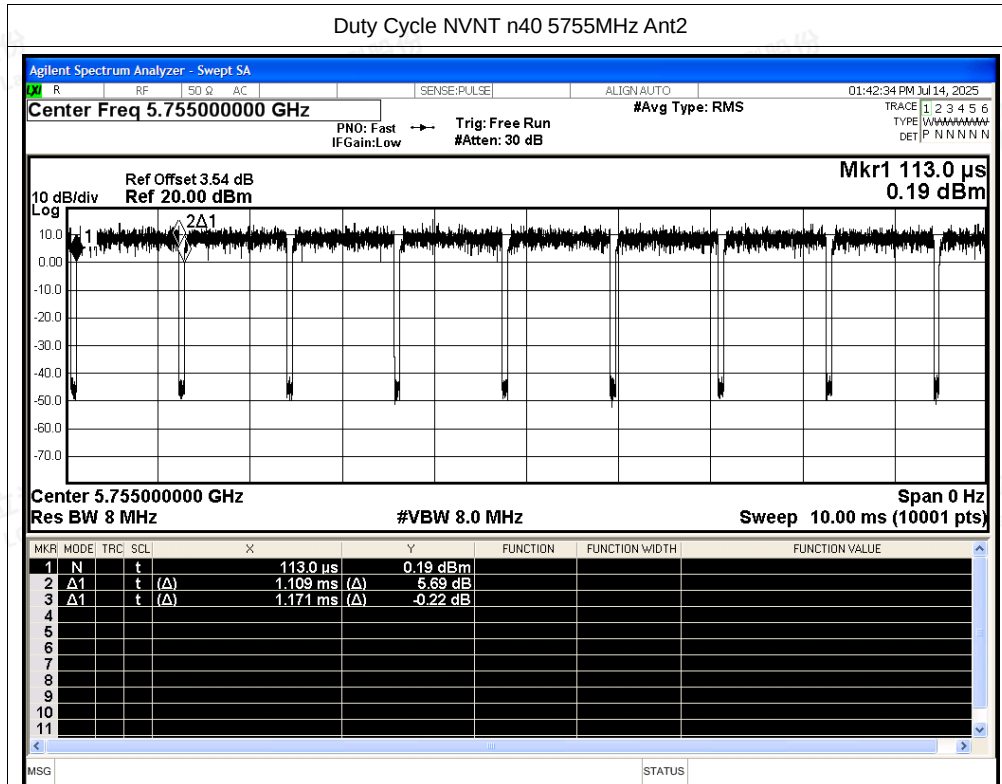


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

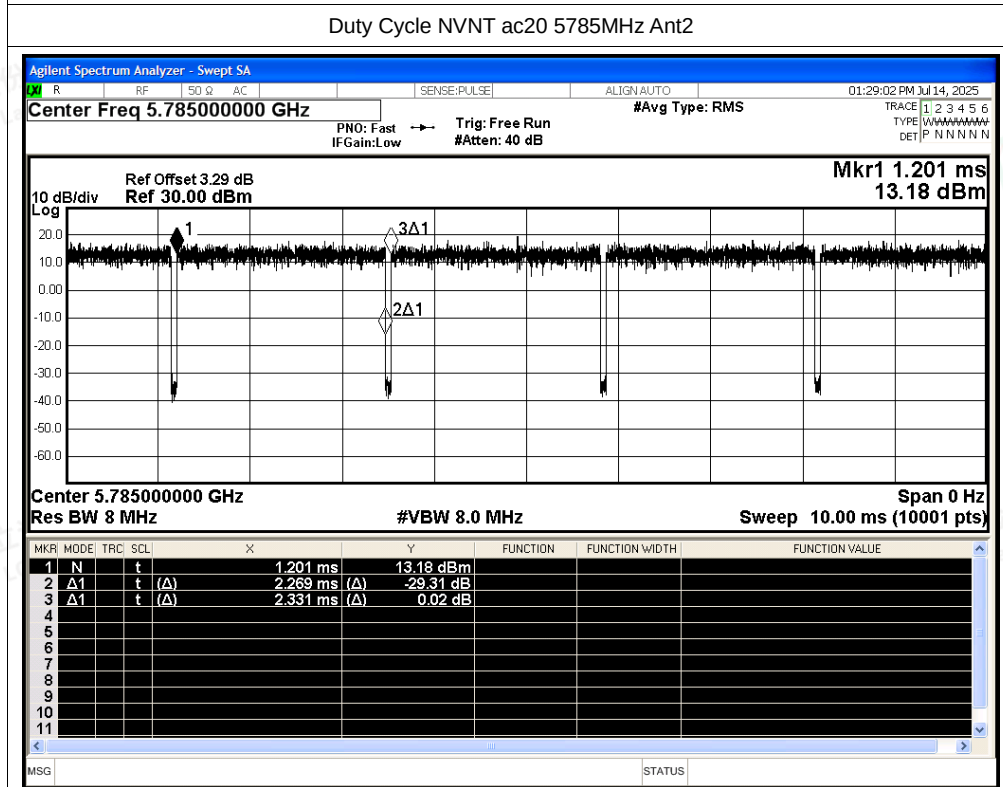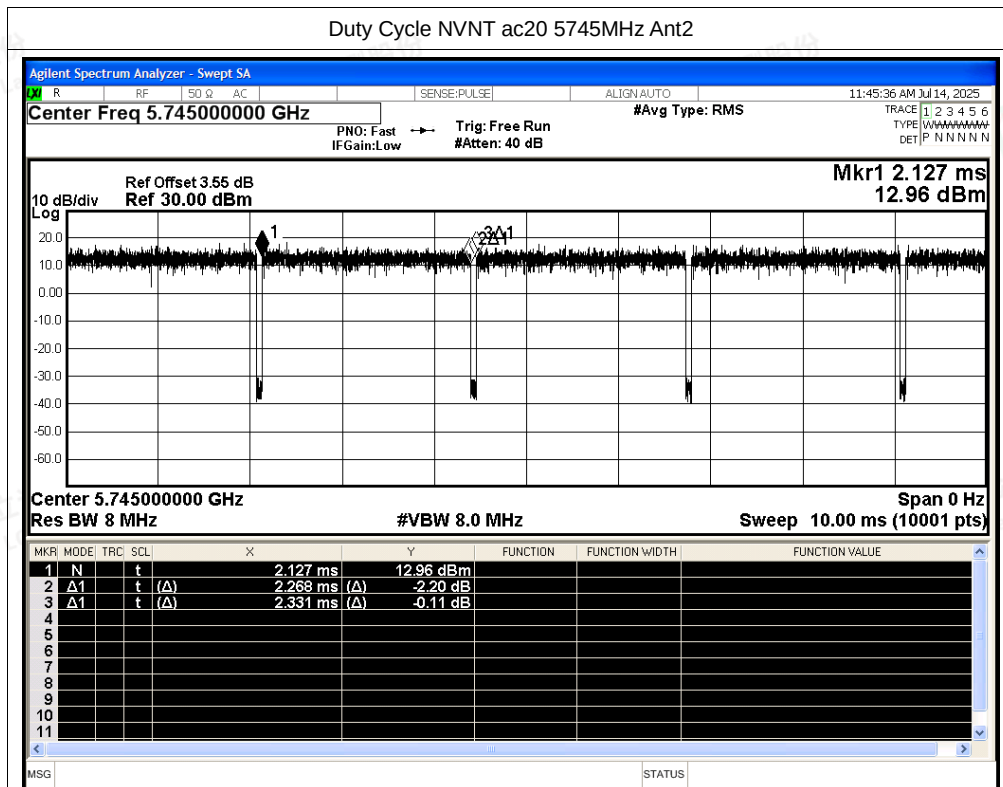

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5825MHz Ant2

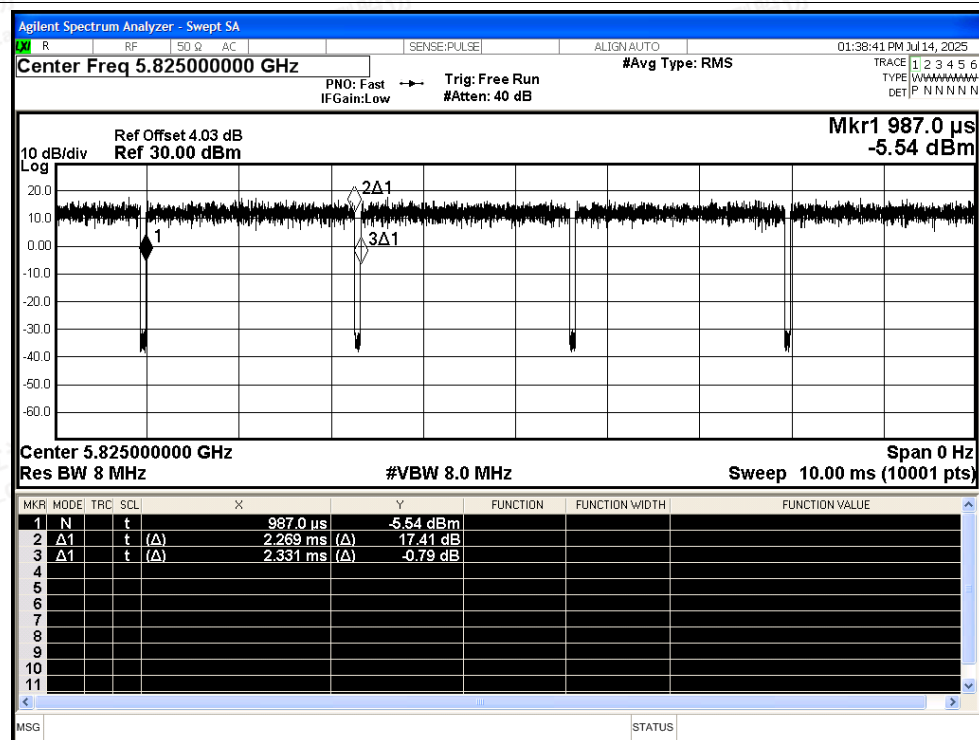

Duty Cycle NVNT ac40 5755MHz Ant2

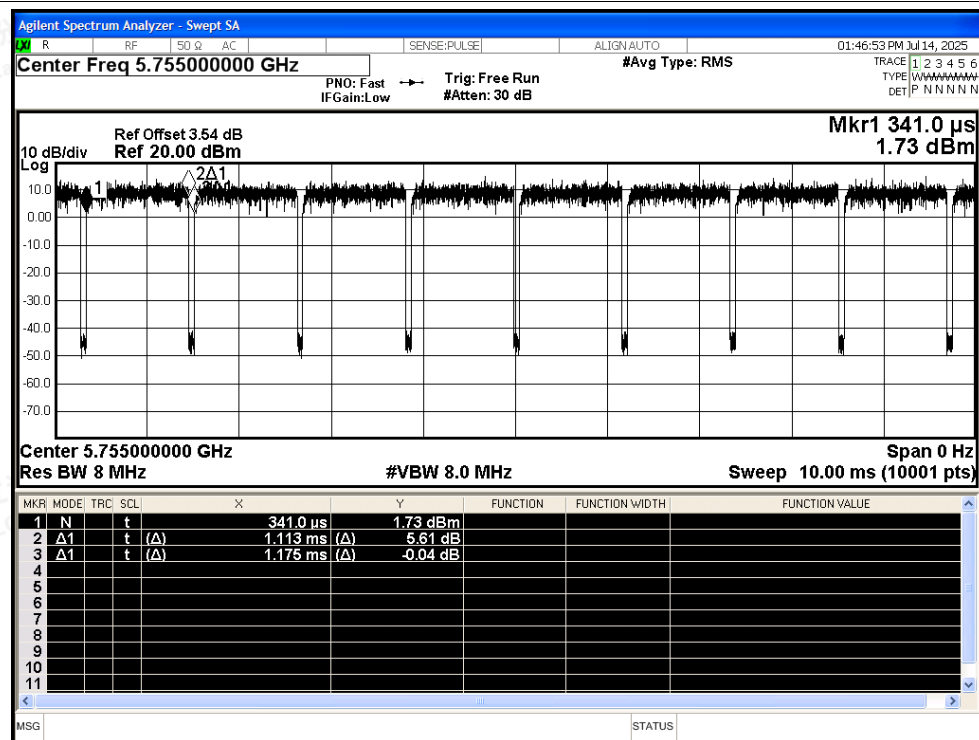

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5795MHz Ant2

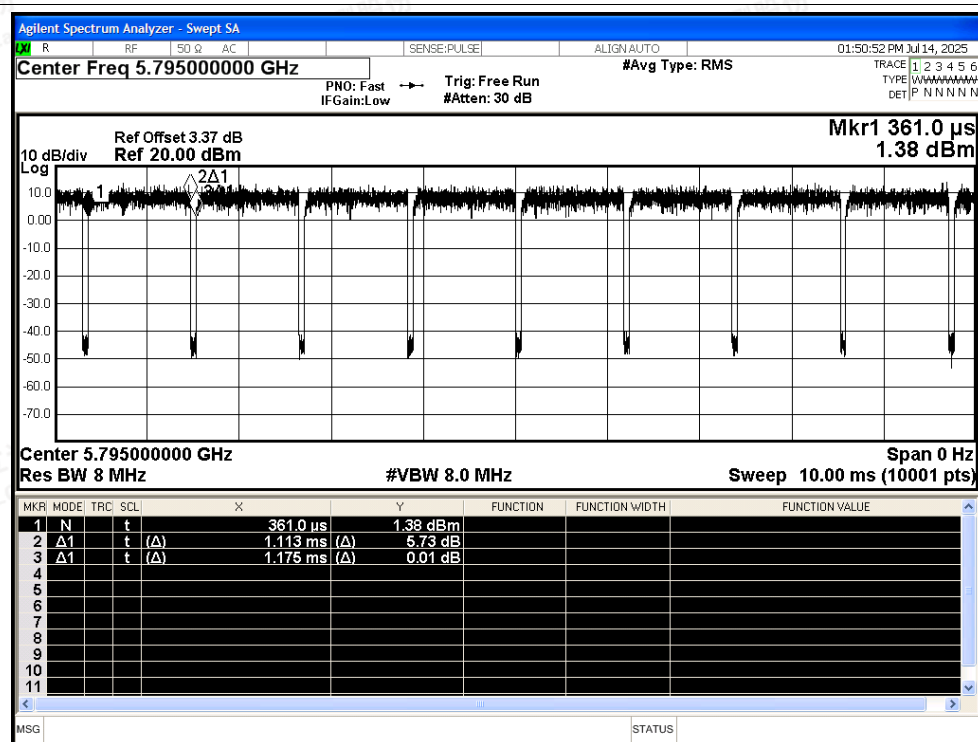

Duty Cycle NVNT ac80 5775MHz Ant2

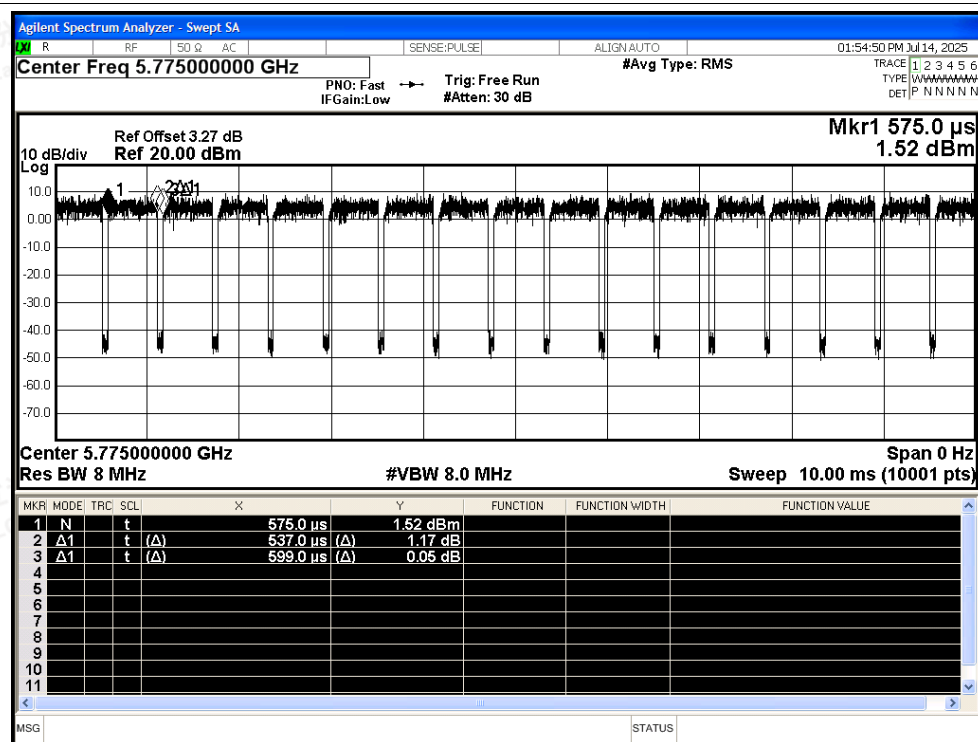

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5745MHz Ant2

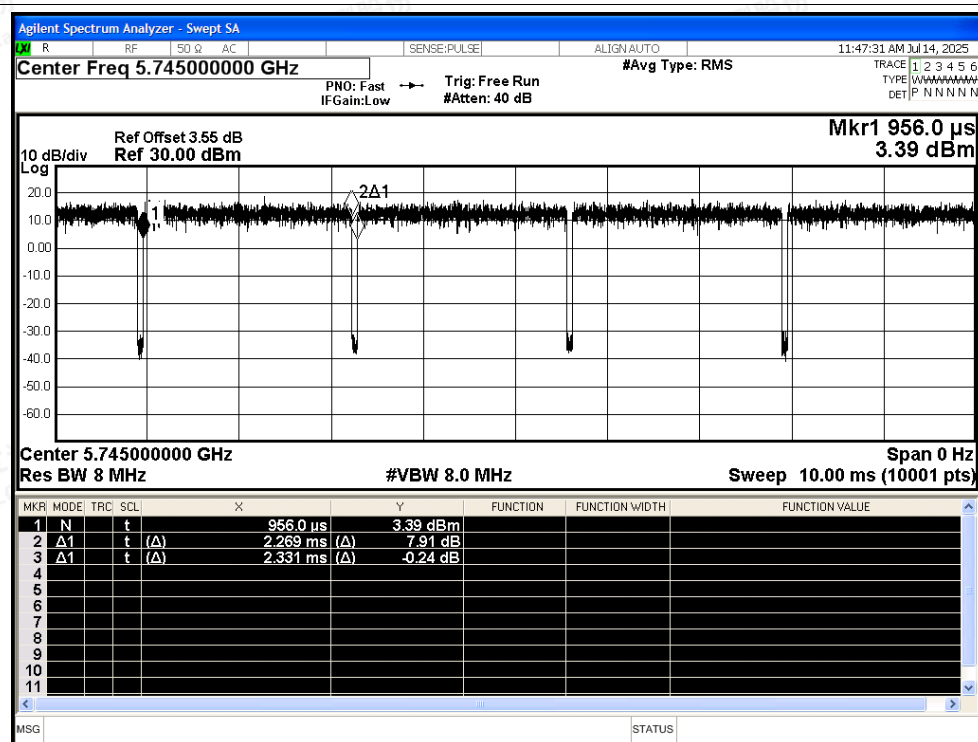

Duty Cycle NVNT ax20 5785MHz Ant2

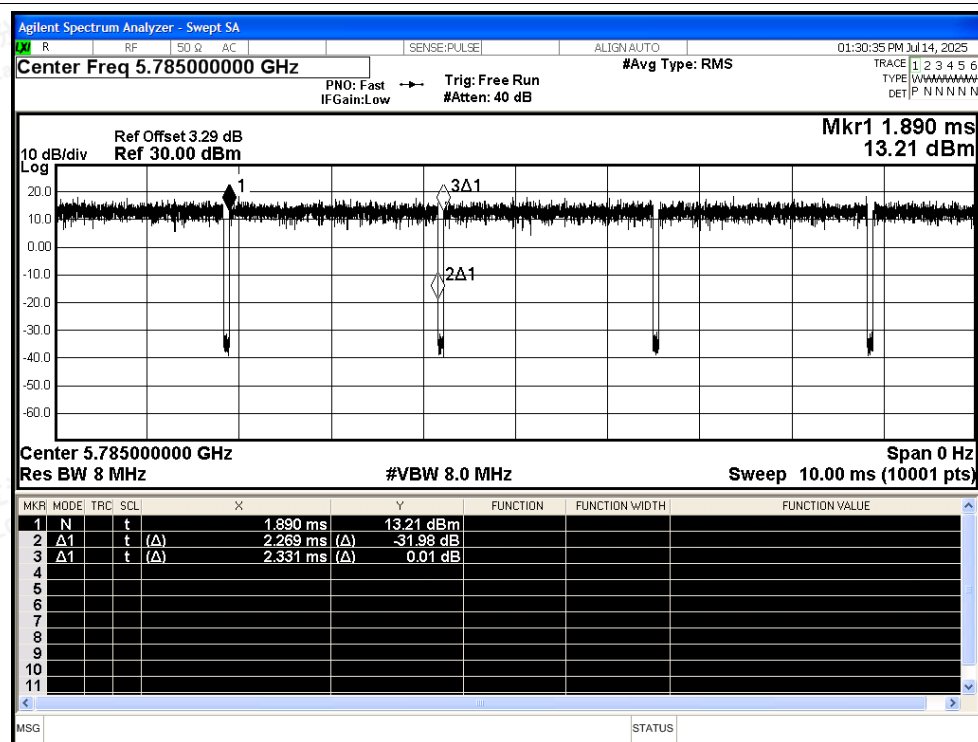

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5825MHz Ant2

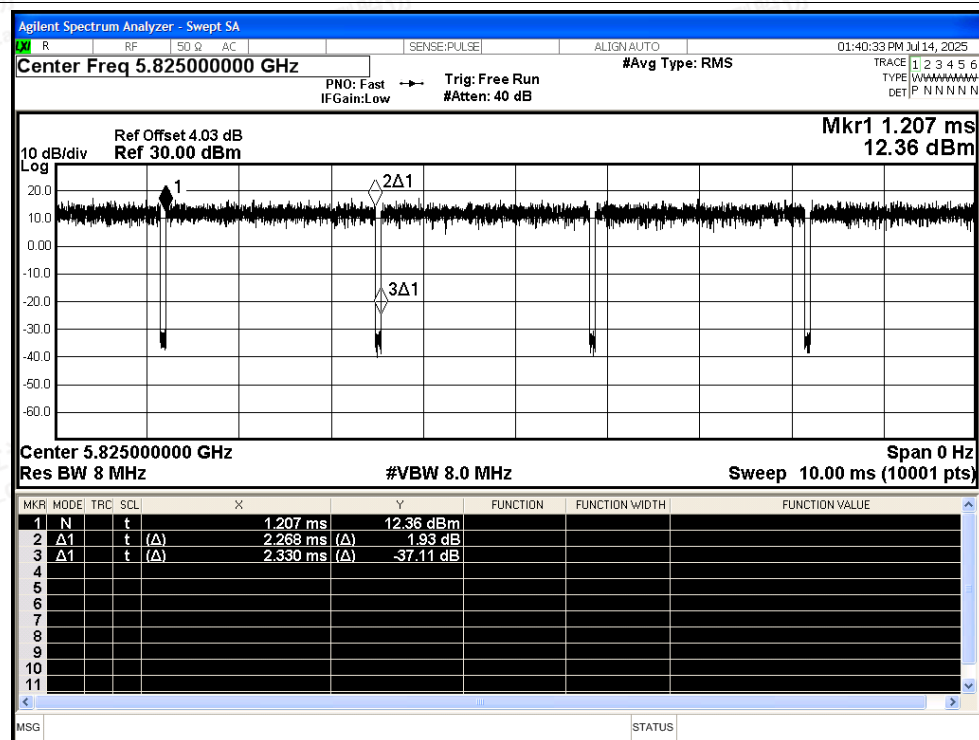

Duty Cycle NVNT ax40 5755MHz Ant2


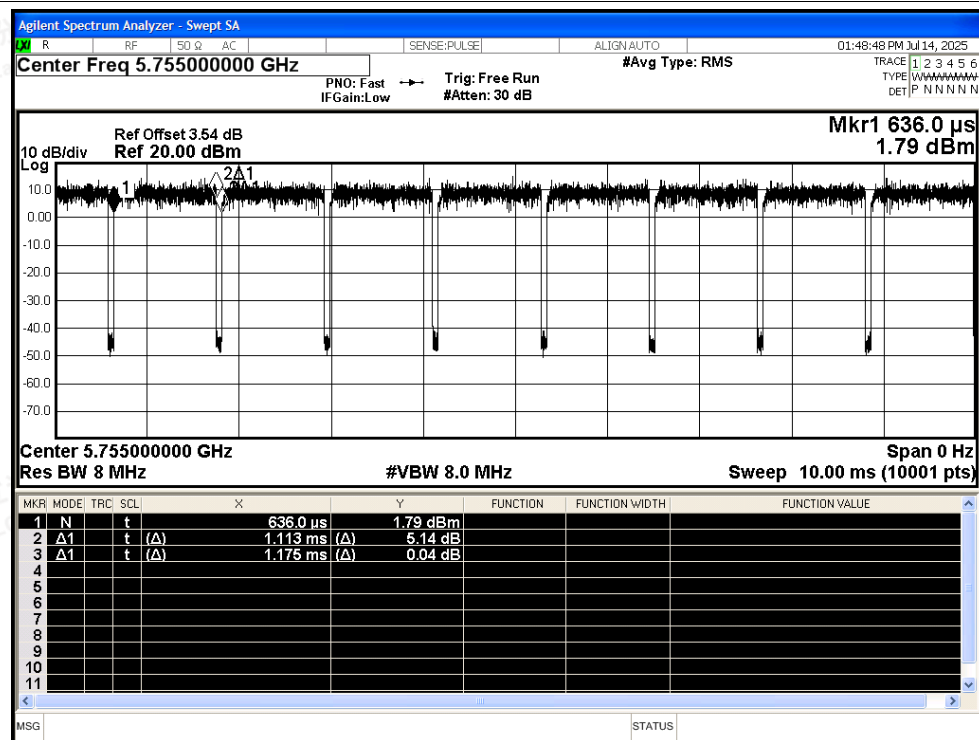


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

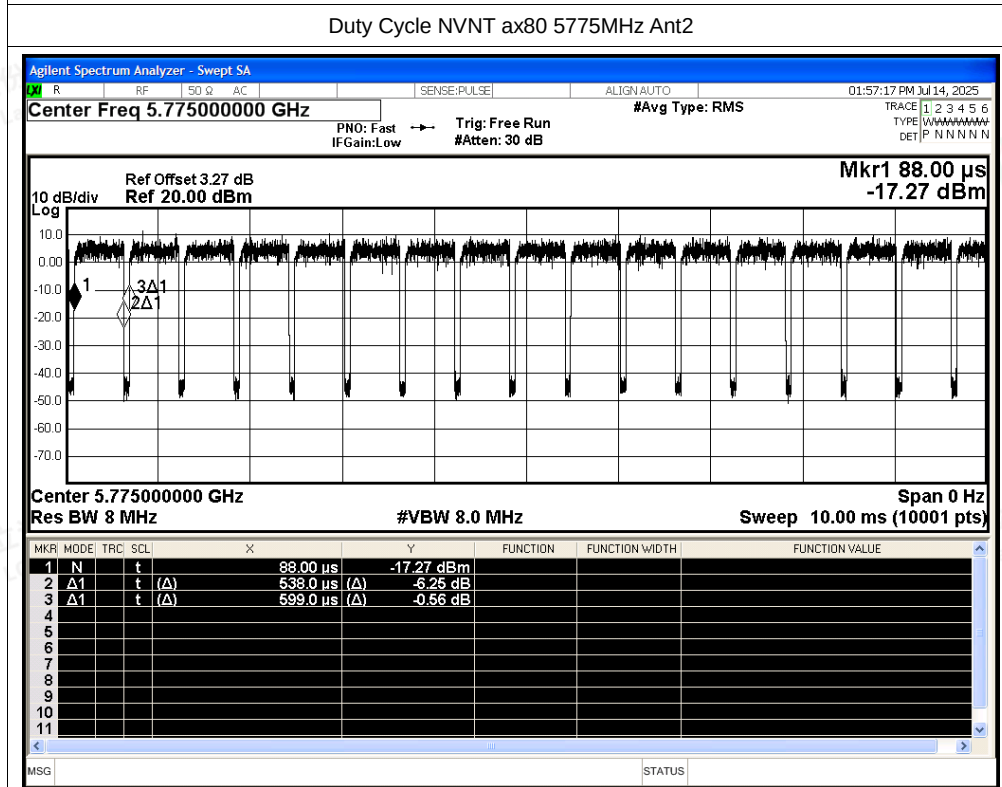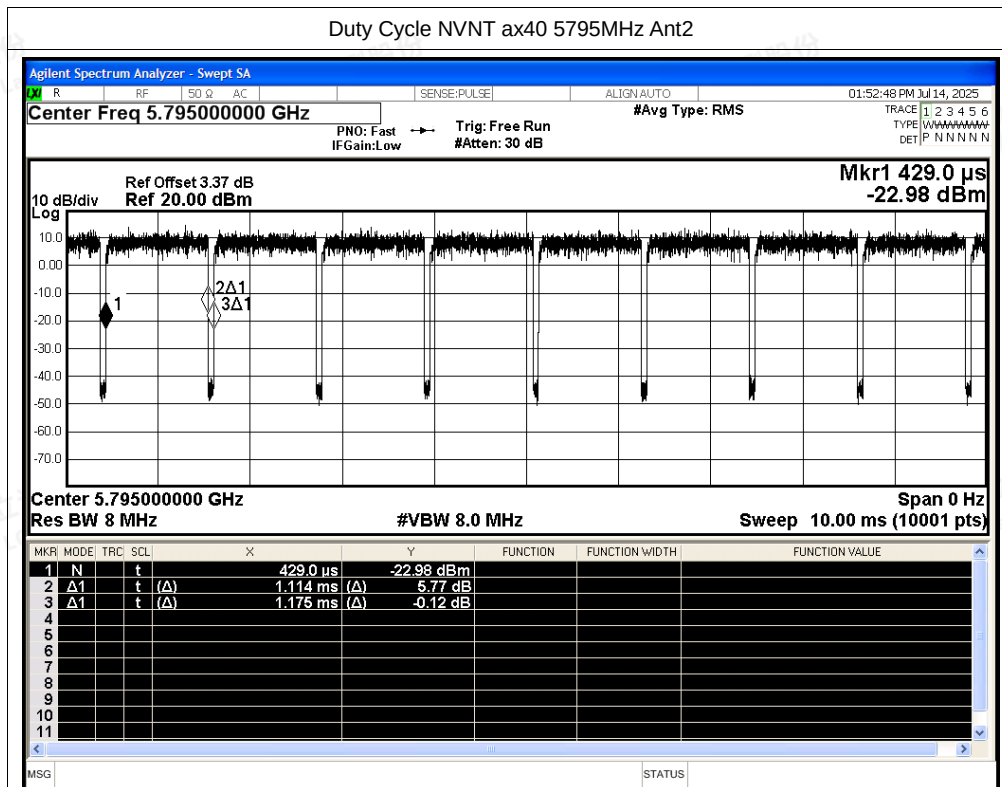

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity