





Restrict Band NVNT n20 5260MHz Ant2 Peak

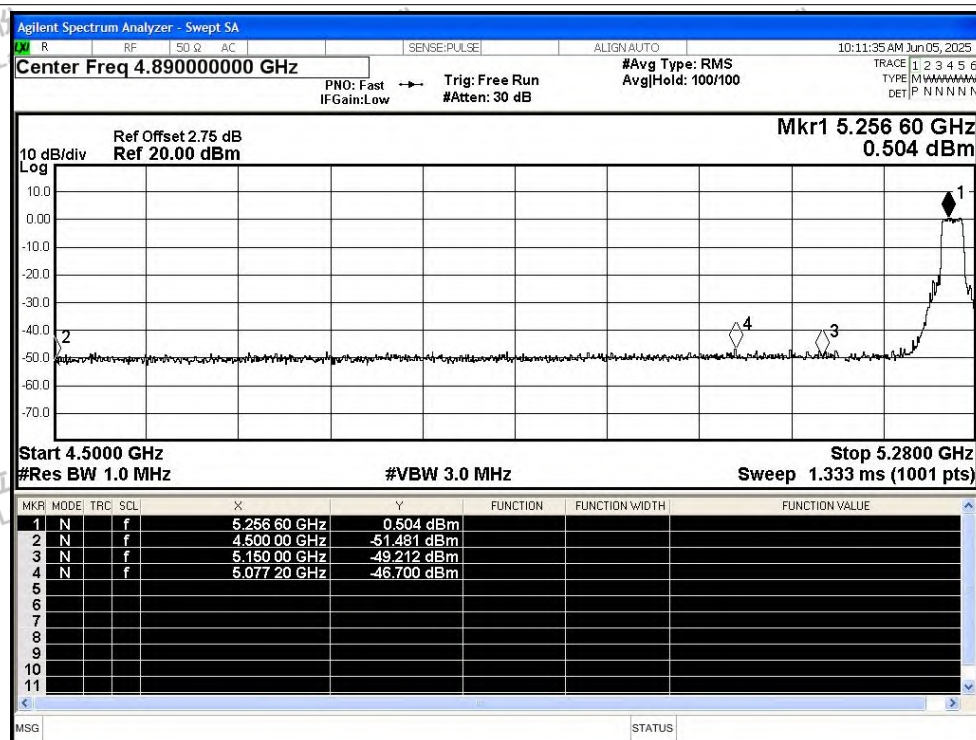

Restrict Band NVNT n20 5260MHz Ant2 Average

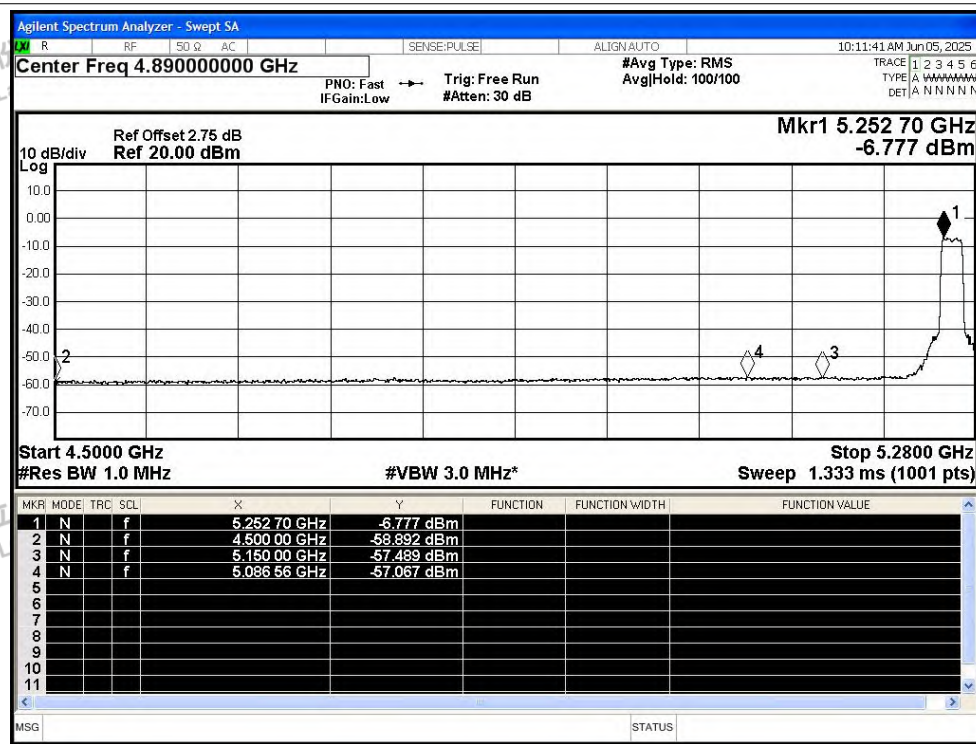

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

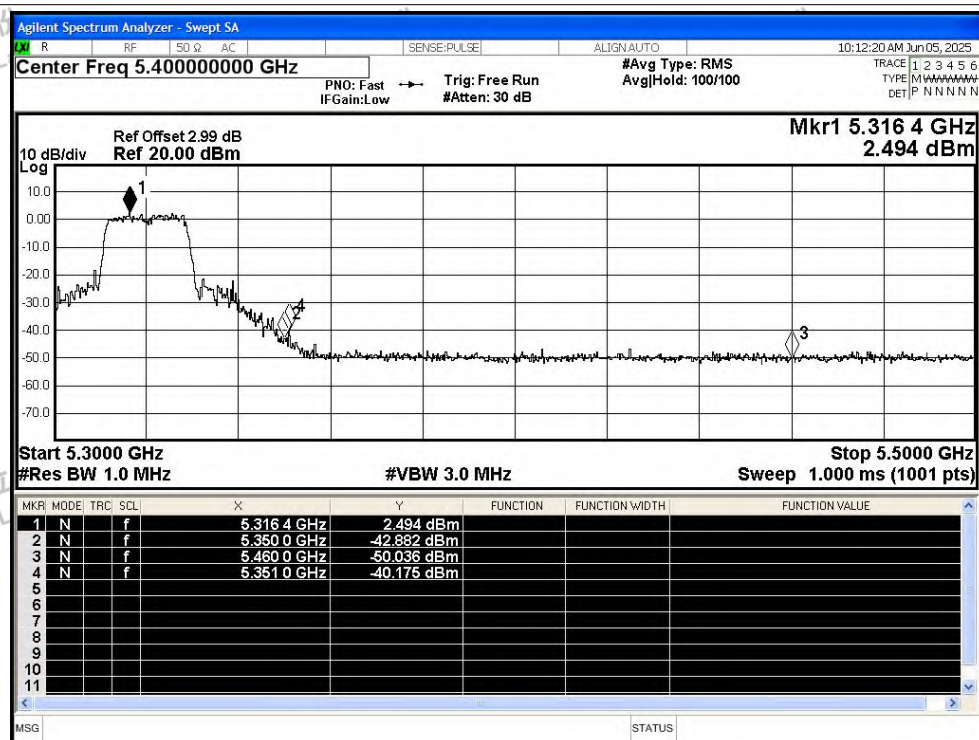

Restrict Band NVNT n20 5320MHz Ant2 Average

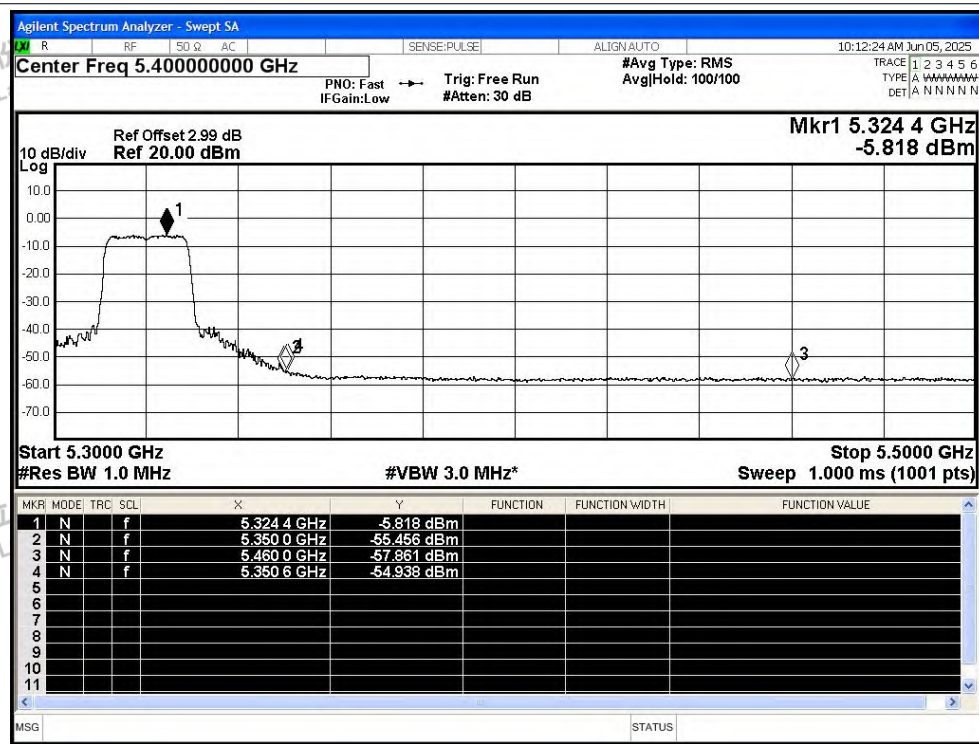

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

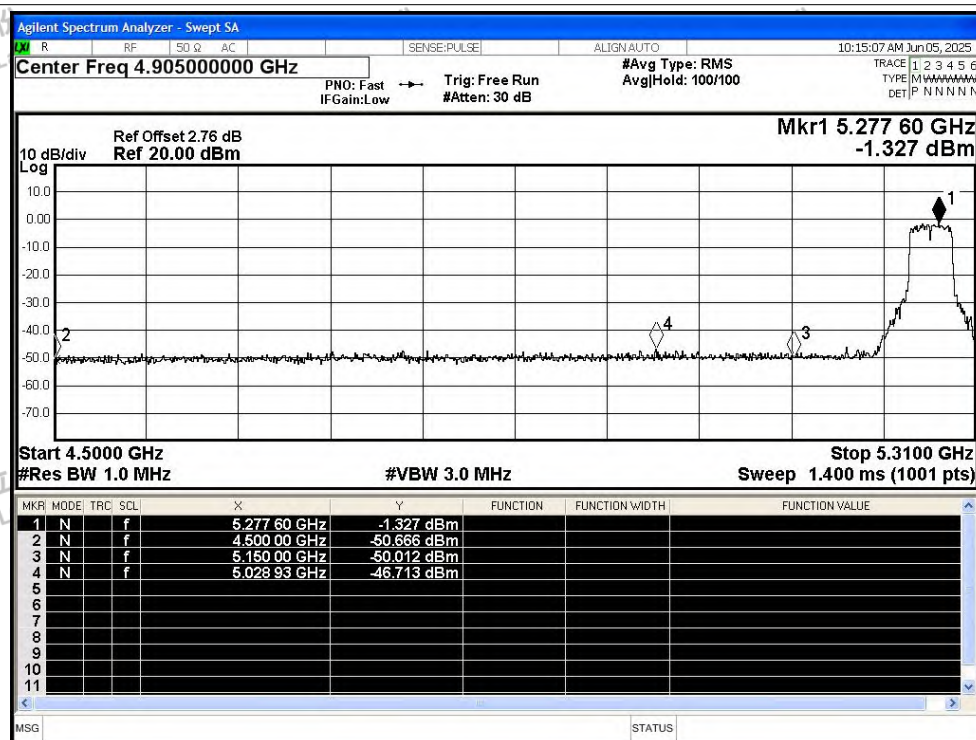

Restrict Band NVNT n40 5270MHz Ant2 Average

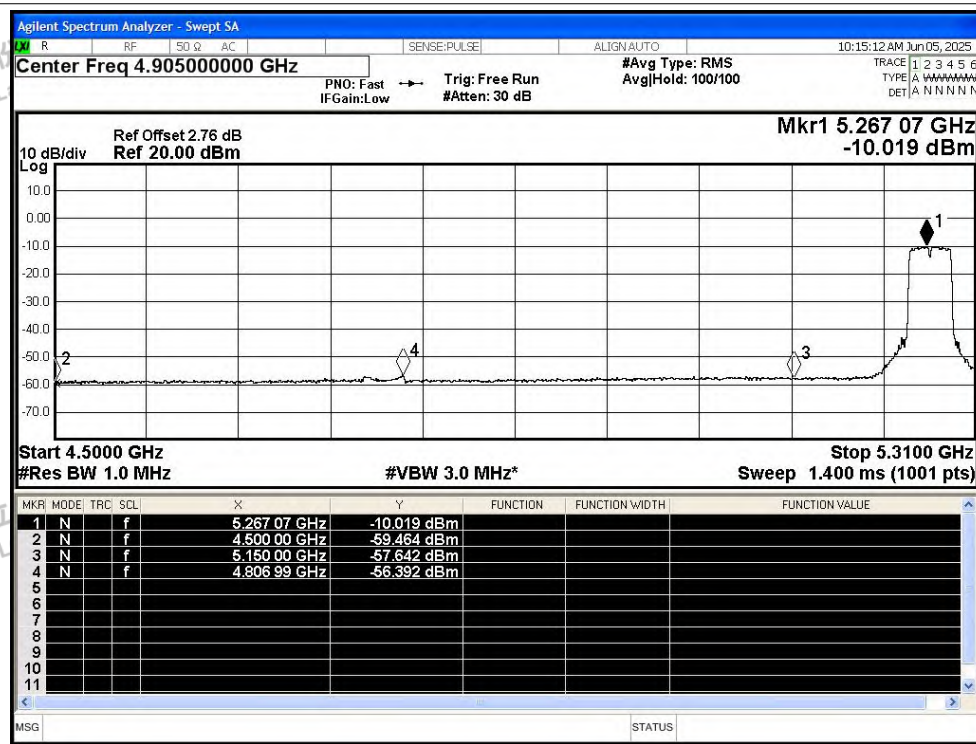

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

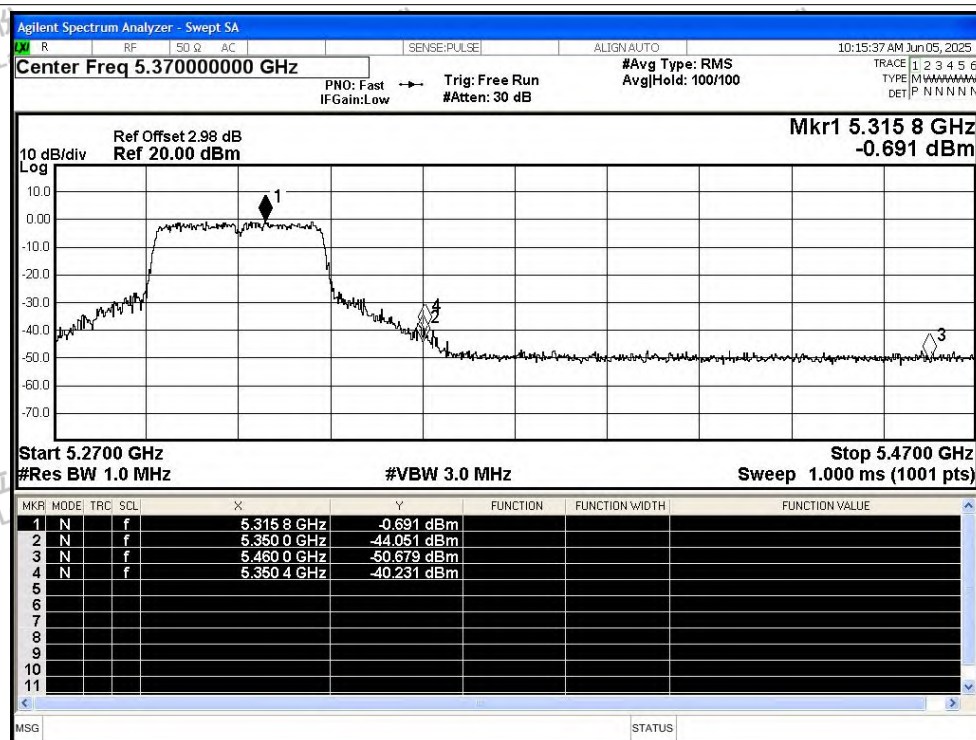

Restrict Band NVNT n40 5310MHz Ant2 Average

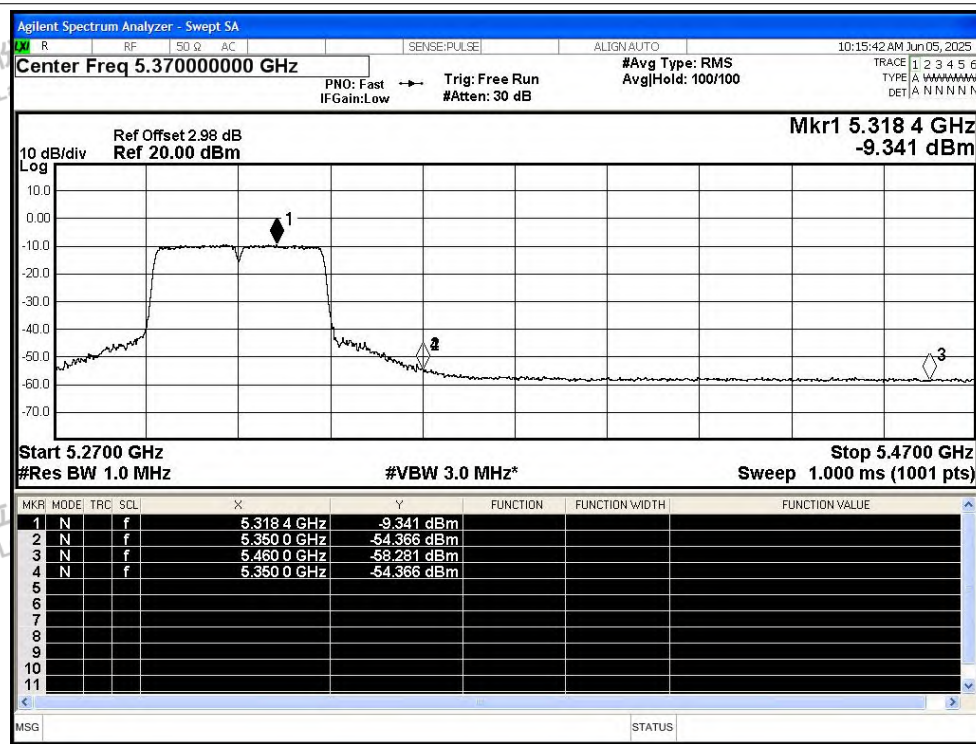

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant2 Peak

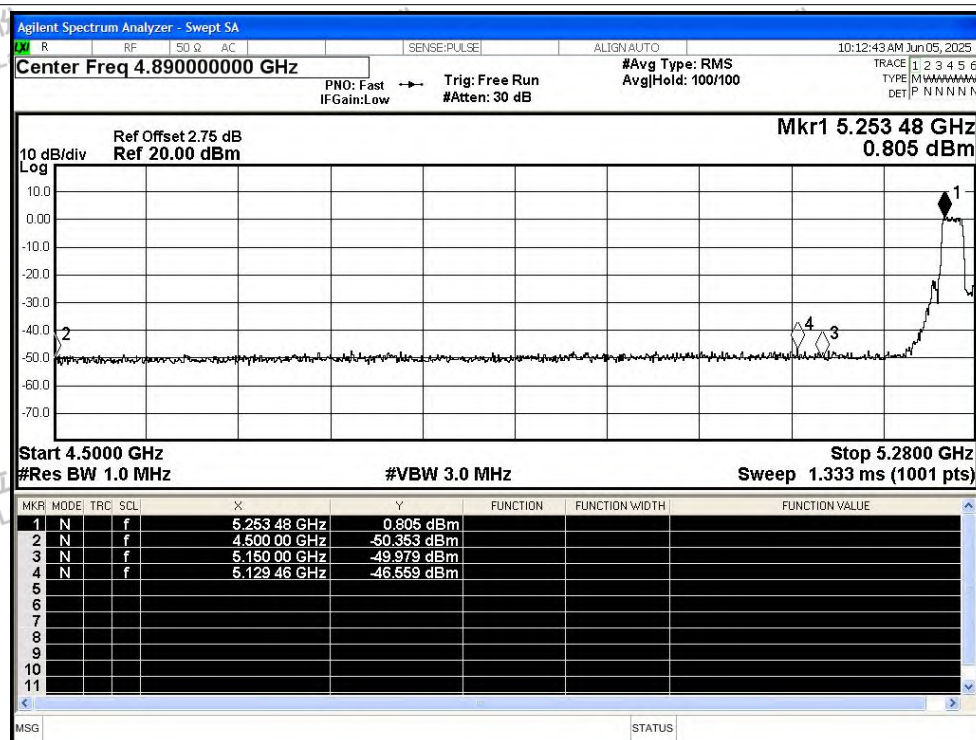

Restrict Band NVNT ac20 5260MHz Ant2 Average

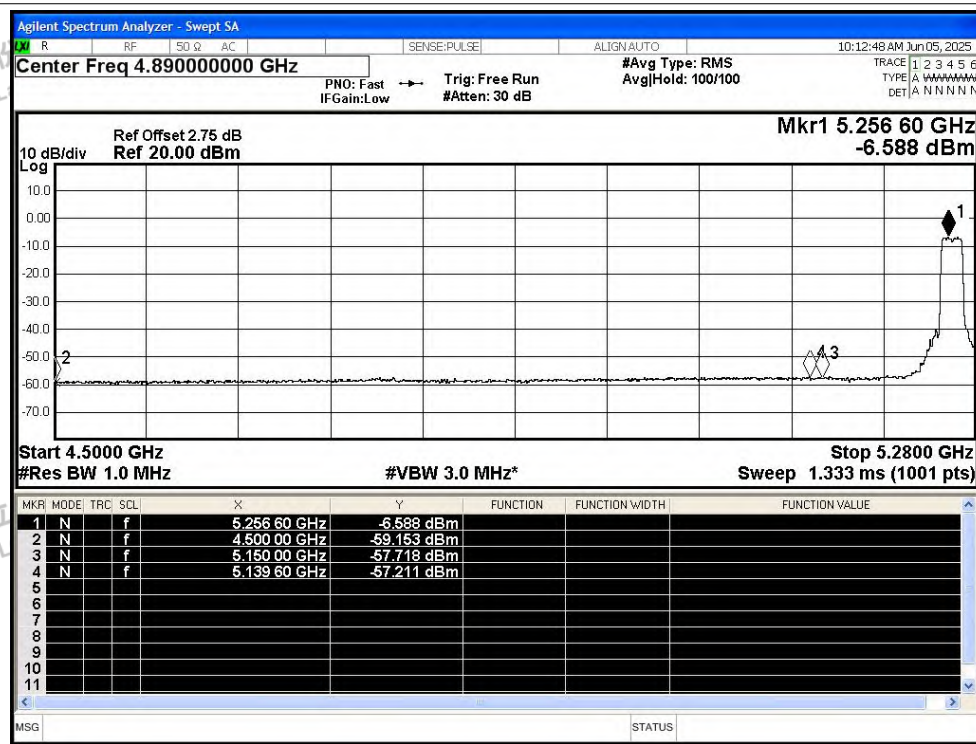

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

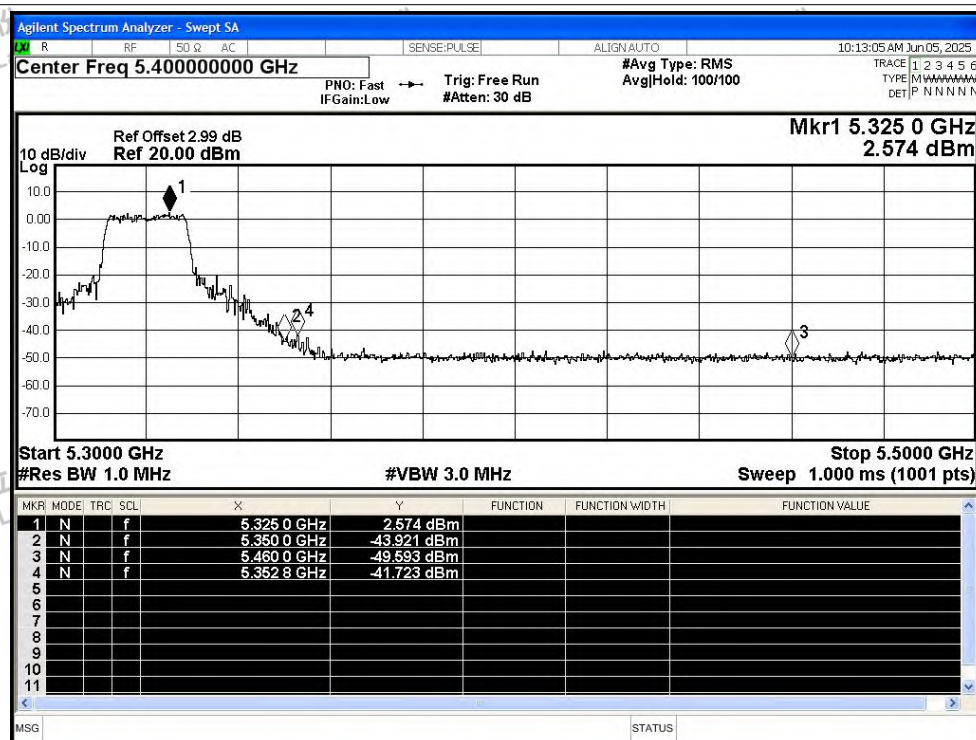

Restrict Band NVNT ac20 5320MHz Ant2 Average

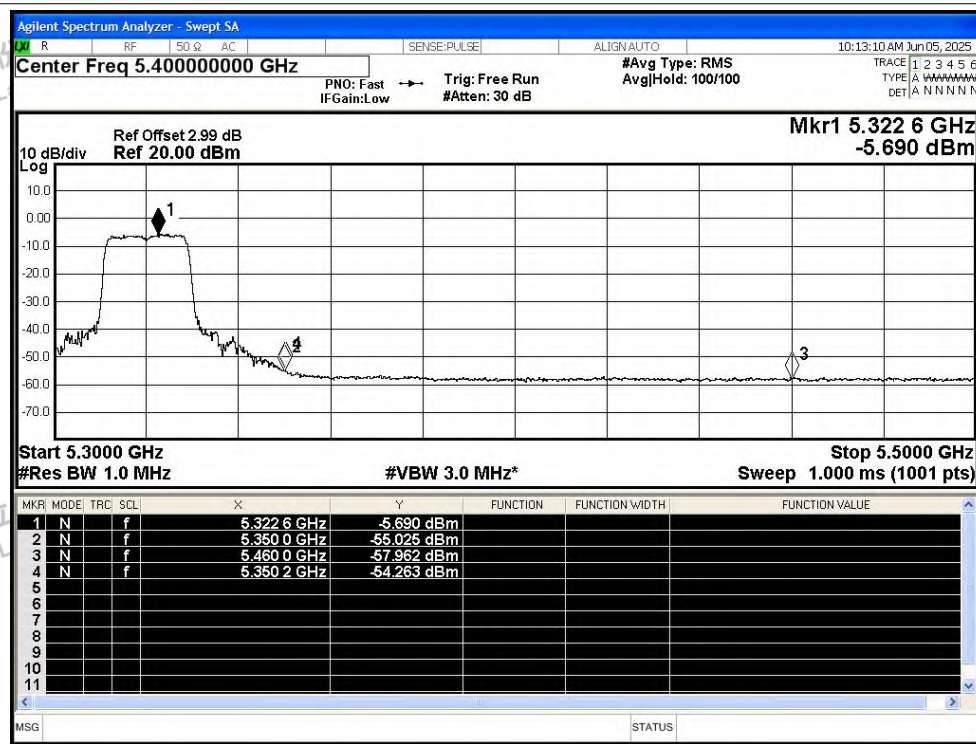

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

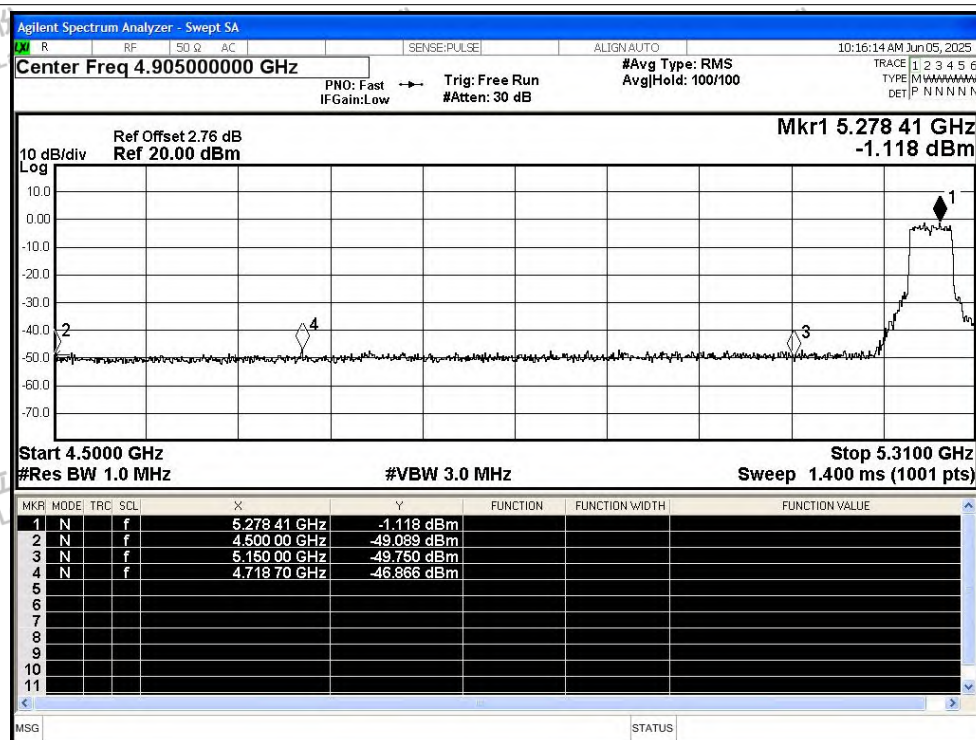

Restrict Band NVNT ac40 5270MHz Ant2 Average

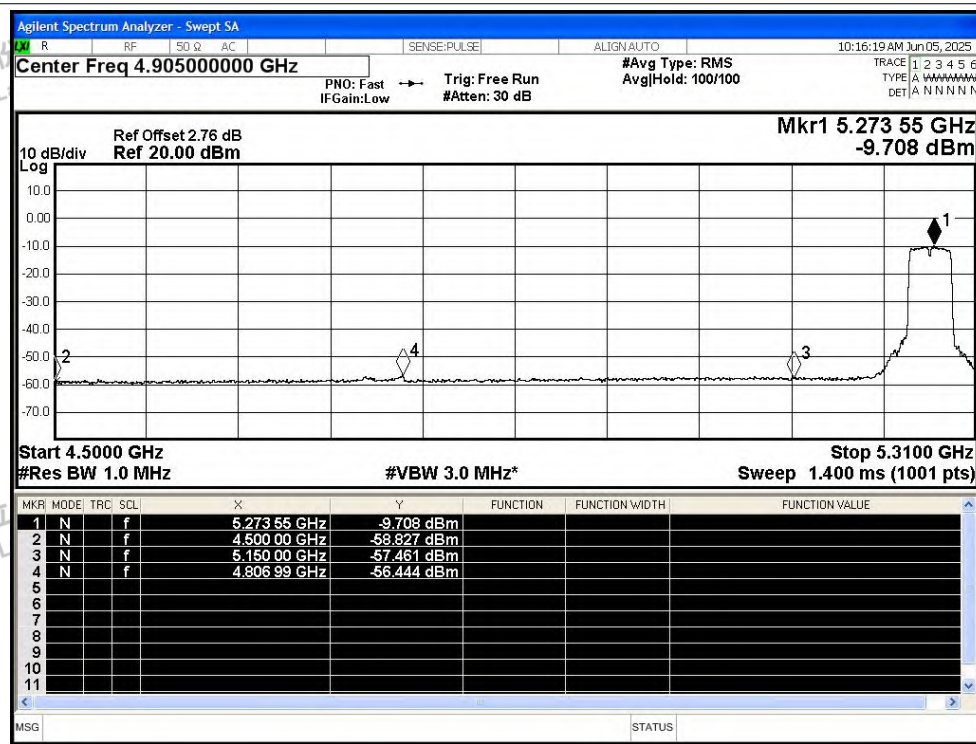

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

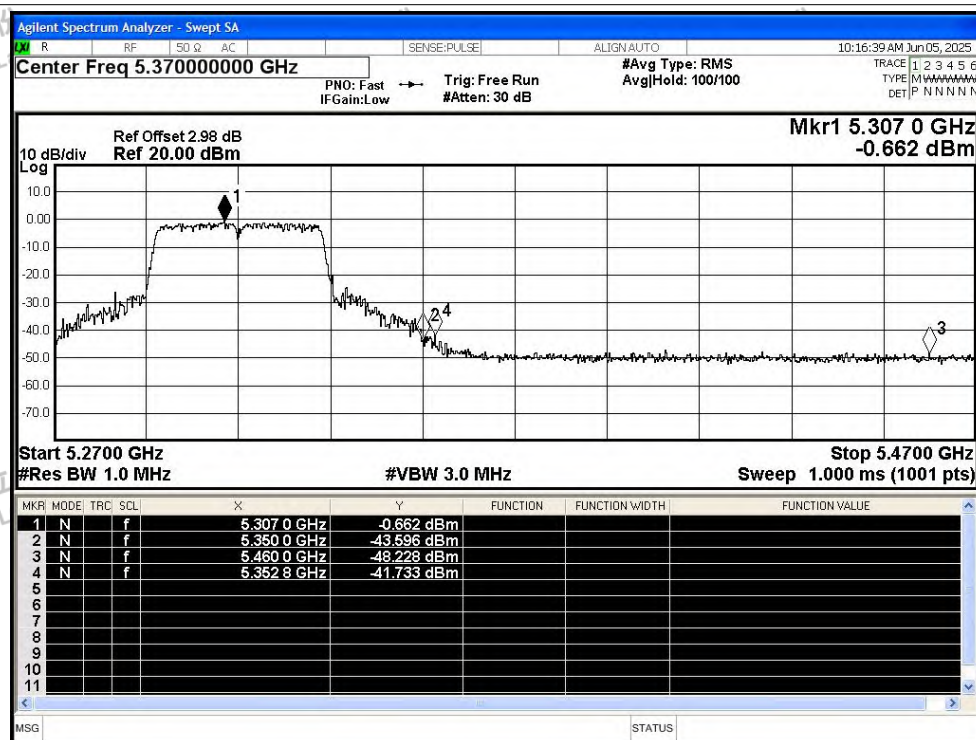

Restrict Band NVNT ac40 5310MHz Ant2 Average

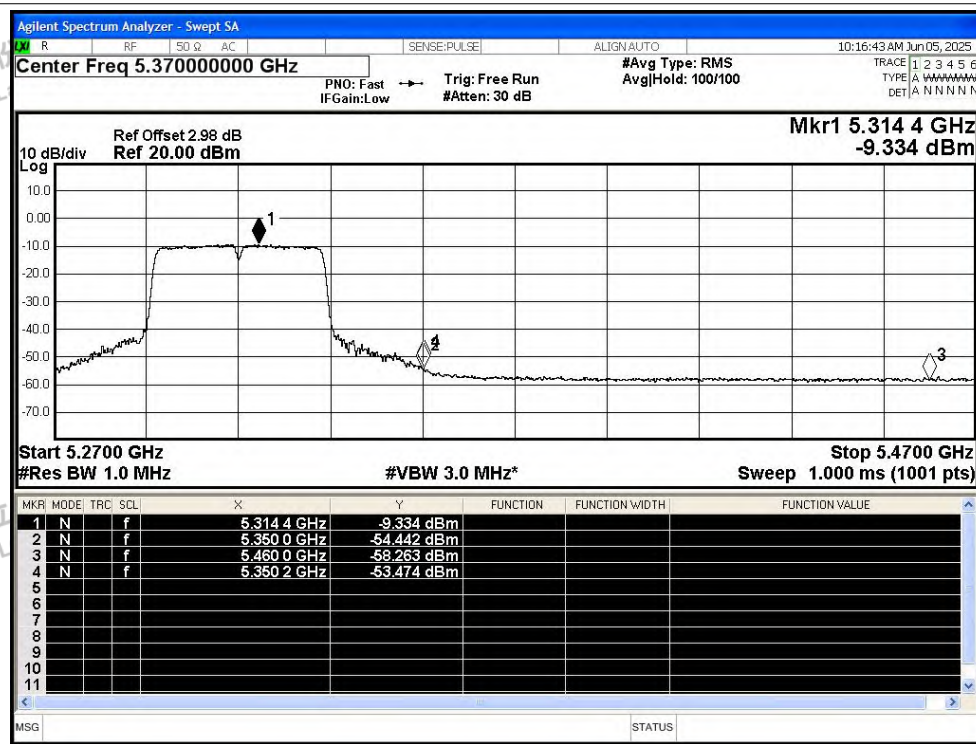

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

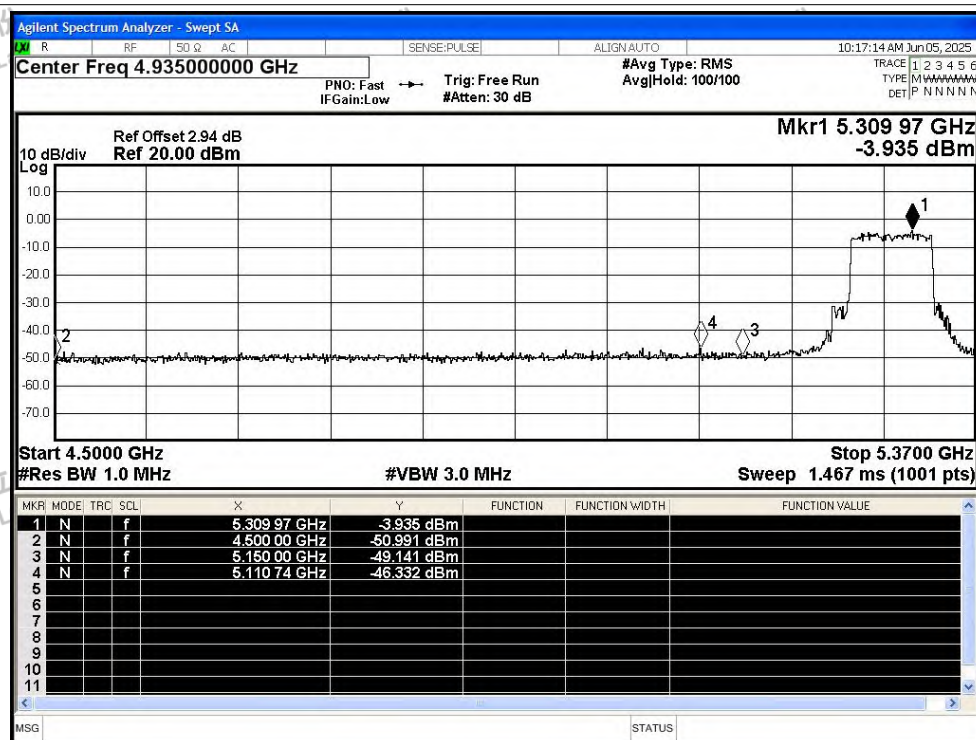

Restrict Band NVNT ac80 5290MHz Ant2 Average

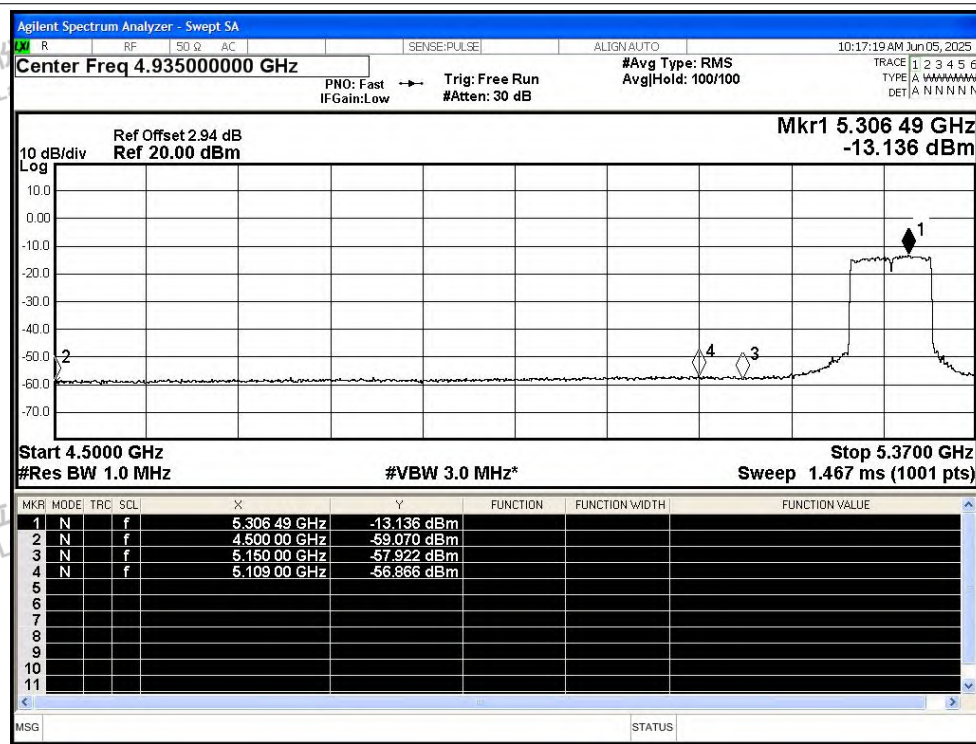

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

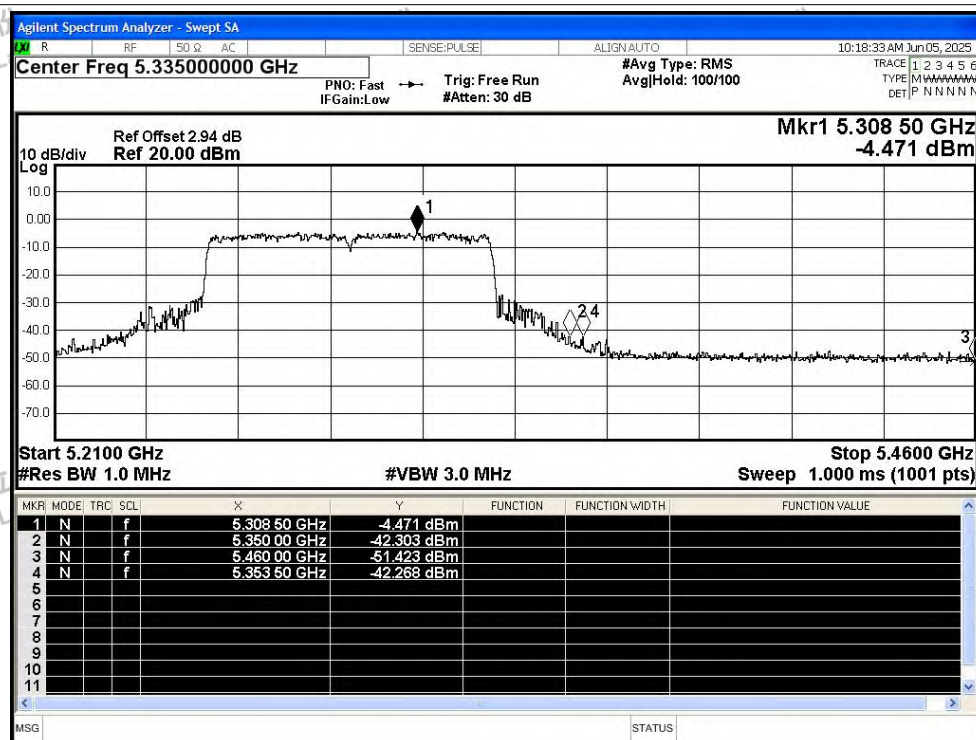

Restrict Band NVNT ac80 5290MHz Ant2 Average

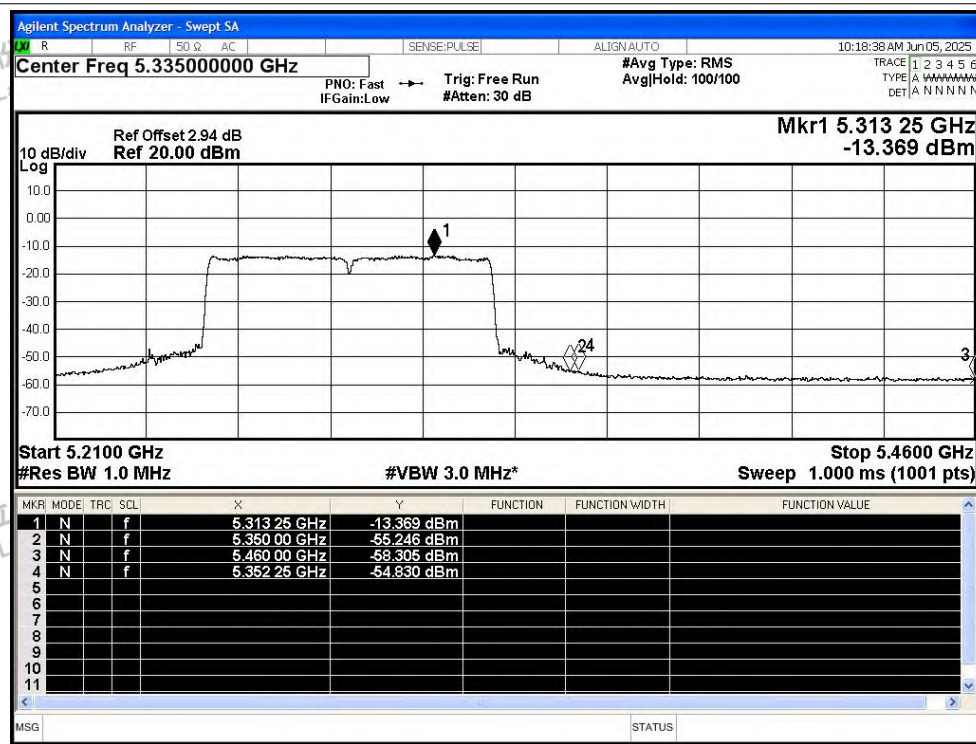

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	4500	-51.13	-51.48	7.04	53.98	Peak	68.2	Pass
NVNT	n20	5260	4500	-59.28	-58.89	7.04	46.20	Average	54	Pass
NVNT	n20	5260	5046	-46.75	-46.7	7.04	58.56	Peak	68.2	Pass
NVNT	n20	5260	5149.74	-56.96	-57.07	7.04	48.27	Average	54	Pass
NVNT	n20	5260	5150	-47.8	-49.21	7.04	56.83	Peak	68.2	Pass
NVNT	n20	5260	5150	-56.96	-57.49	7.04	48.06	Average	54	Pass
NVNT	n20	5320	5350	-44.82	-42.88	7.04	61.54	Peak	68.2	Pass
NVNT	n20	5320	5350	-54.99	-55.46	7.04	50.06	Average	54	Pass
NVNT	n20	5320	5350.8	-40.01	-40.17	7.04	65.19	Peak	68.2	Pass
NVNT	n20	5320	5350.8	-54.7	-54.94	7.04	50.46	Average	54	Pass
NVNT	n20	5320	5460	-49.53	-50.04	7.04	55.50	Peak	68.2	Pass
NVNT	n20	5320	5460	-57.95	-57.86	7.04	47.38	Average	54	Pass
NVNT	n40	5270	4500	-50.86	-50.67	7.04	54.52	Peak	68.2	Pass
NVNT	n40	5270	4500	-59.57	-59.46	7.04	45.77	Average	54	Pass
NVNT	n40	5270	5033.79	-46.93	-46.71	7.04	58.46	Peak	68.2	Pass
NVNT	n40	5270	4772.97	-56.89	-56.39	7.04	48.65	Average	54	Pass
NVNT	n40	5270	5150	-48.63	-50.01	7.04	56.01	Peak	68.2	Pass
NVNT	n40	5270	5150	-57.27	-57.64	7.04	47.83	Average	54	Pass
NVNT	n40	5310	5350	-42.83	-44.05	7.04	61.88	Peak	68.2	Pass
NVNT	n40	5310	5350	-53.95	-54.37	7.04	51.13	Average	54	Pass
NVNT	n40	5310	5351	-41.76	-40.23	7.04	64.35	Peak	68.2	Pass
NVNT	n40	5310	5350	-53.95	-54.37	7.04	51.13	Average	54	Pass
NVNT	n40	5310	5460	-49.61	-50.68	7.04	55.17	Peak	68.2	Pass
NVNT	n40	5310	5460	-58.27	-58.28	7.04	47.01	Average	54	Pass
NVNT	ac20	5260	4500	-49.61	-50.35	7.04	55.32	Peak	68.2	Pass
NVNT	ac20	5260	4500	-59.43	-59.15	7.04	45.99	Average	54	Pass
NVNT	ac20	5260	4679.4	-47.47	-46.56	7.04	58.29	Peak	68.2	Pass
NVNT	ac20	5260	5066.28	-56.96	-57.21	7.04	48.20	Average	54	Pass
NVNT	ac20	5260	5150	-49.38	-49.98	7.04	55.61	Peak	68.2	Pass
NVNT	ac20	5260	5150	-57.28	-57.72	7.04	47.79	Average	54	Pass
NVNT	ac20	5320	5350	-41.93	-43.92	7.04	62.47	Peak	68.2	Pass
NVNT	ac20	5320	5350	-55.77	-55.03	7.04	49.90	Average	54	Pass
NVNT	ac20	5320	5352.2	-41.09	-41.72	7.04	63.89	Peak	68.2	Pass
NVNT	ac20	5320	5350.2	-54.89	-54.26	7.04	50.72	Average	54	Pass
NVNT	ac20	5320	5460	-49.41	-49.59	7.04	55.78	Peak	68.2	Pass
NVNT	ac20	5320	5460	-57.95	-57.96	7.04	47.33	Average	54	Pass
NVNT	ac40	5310	4500	-50.29	-49.09	7.04	55.63	Peak	68.2	Pass
NVNT	ac40	5310	4500	-59.04	-58.83	7.04	46.35	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5310	5009.49	-47.07	-46.87	7.04	58.31	Peak	68.2	Pass
NVNT	ac40	5310	4806.18	-56.85	-56.44	7.04	48.64	Average	54	Pass
NVNT	ac40	5310	5150	-48.87	-49.75	7.04	55.99	Peak	68.2	Pass
NVNT	ac40	5310	5150	-57.96	-57.46	7.04	47.58	Average	54	Pass
NVNT	ac40	5310	5350	-40.44	-43.6	7.04	63.54	Peak	68.2	Pass
NVNT	ac40	5310	5350	-55.03	-54.44	7.04	50.56	Average	54	Pass
NVNT	ac40	5310	5350.6	-38.85	-41.73	7.04	65.22	Peak	68.2	Pass
NVNT	ac40	5310	5351	-54.31	-53.47	7.04	51.41	Average	54	Pass
NVNT	ac40	5310	5460	-50.25	-48.23	7.04	56.16	Peak	68.2	Pass
NVNT	ac40	5310	5460	-58.58	-58.26	7.04	46.86	Average	54	Pass
NVNT	ac80	5290	4500	-50.02	-50.99	7.04	54.80	Peak	68.2	Pass
NVNT	ac80	5290	4500	-59.08	-59.07	7.04	46.21	Average	54	Pass
NVNT	ac80	5290	5048.97	-46.69	-46.33	7.04	58.77	Peak	68.2	Pass
NVNT	ac80	5290	5089.86	-56.81	-56.87	7.04	48.44	Average	54	Pass
NVNT	ac80	5290	5150	-47.37	-49.14	7.04	57.11	Peak	68.2	Pass
NVNT	ac80	5290	5150	-57.34	-57.92	7.04	47.66	Average	54	Pass
NVNT	ac80	5290	5350	-44.02	-42.3	7.04	62.20	Peak	68.2	Pass
NVNT	ac80	5290	5350	-56.19	-55.25	7.04	49.59	Average	54	Pass
NVNT	ac80	5290	5350.25	-40.98	-42.27	7.04	63.70	Peak	68.2	Pass
NVNT	ac80	5290	5351.5	-55.37	-54.83	7.04	50.19	Average	54	Pass
NVNT	ac80	5290	5460	-48.32	-51.42	7.04	55.68	Peak	68.2	Pass
NVNT	ac80	5290	5460	-58	-58.31	7.04	47.13	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	a	5300	Ant1	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant1	5259.98	-20000	-3.8	25	Pass
NVNT	n20	5300	Ant1	5300	0	0	25	Pass
NVNT	n20	5320	Ant1	5320	0	0	25	Pass
NVNT	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant1	5310	0	0	25	Pass
NVNT	ac20	5260	Ant1	5260	0	0	25	Pass
NVNT	ac20	5300	Ant1	5300	0	0	25	Pass
NVNT	ac20	5320	Ant1	5319.98	-20000	-3.76	25	Pass
NVNT	ac40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	ac40	5310	Ant1	5309.96	-40000	-7.53	25	Pass
NVNT	ac80	5290	Ant1	5289.92	-80000	-15.12	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

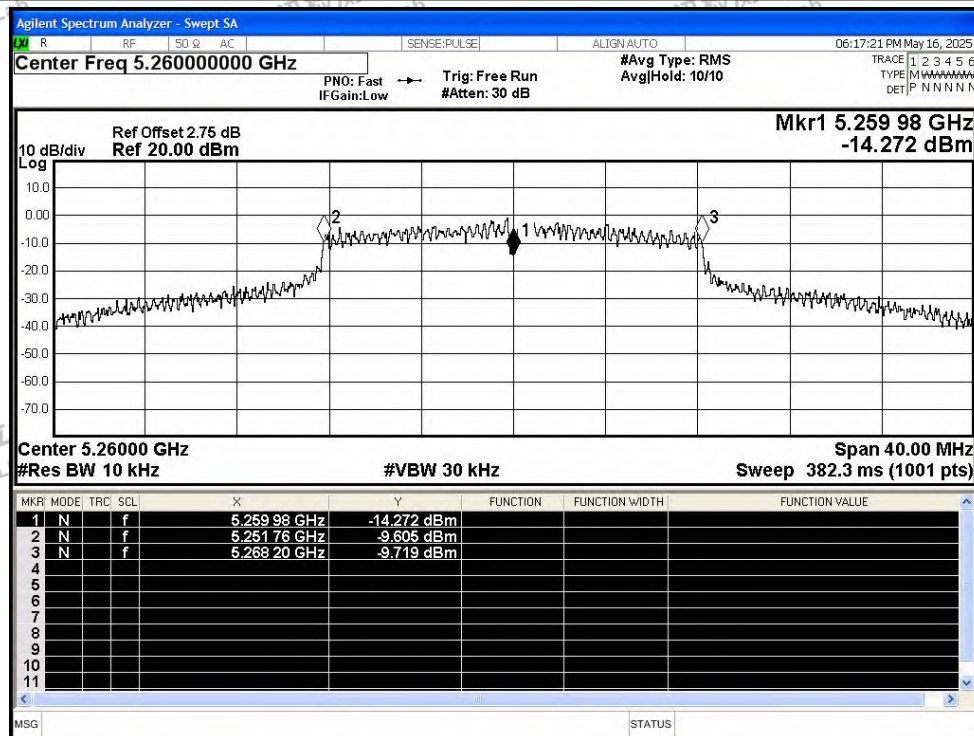

Freq. Stability NVNT a 5300MHz Ant1

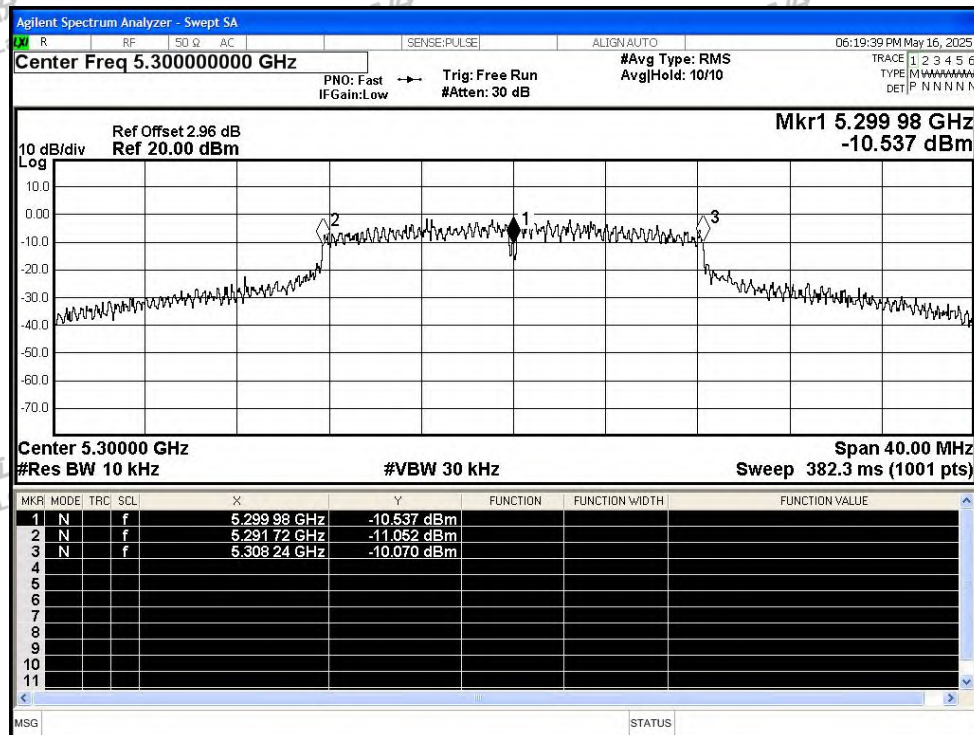

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant1

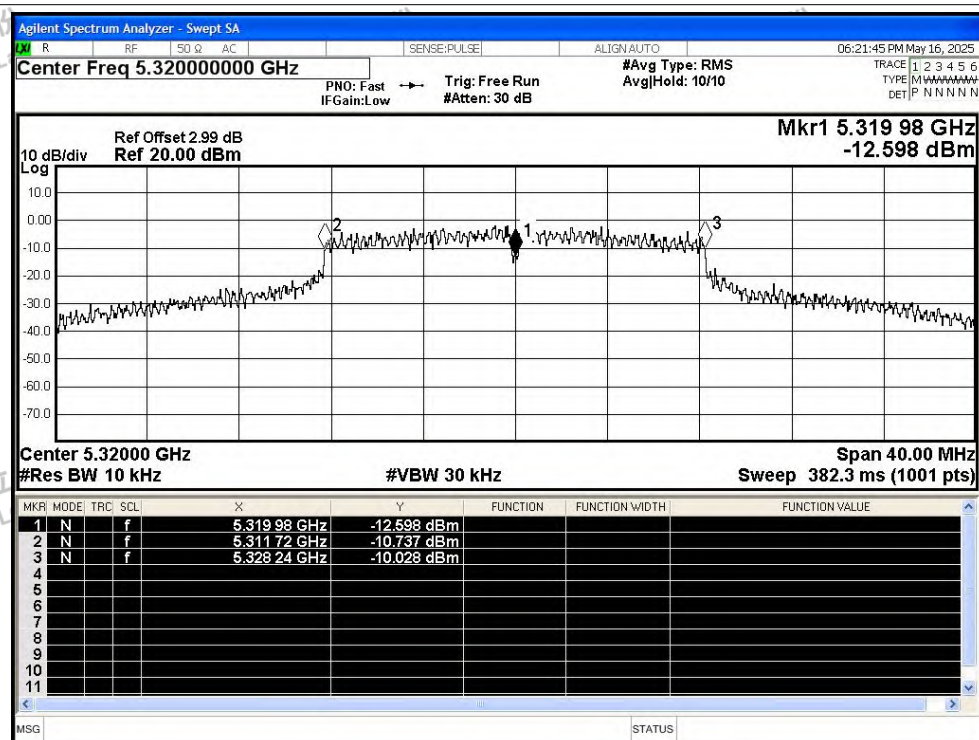

Freq. Stability NVNT n20 5260MHz Ant1

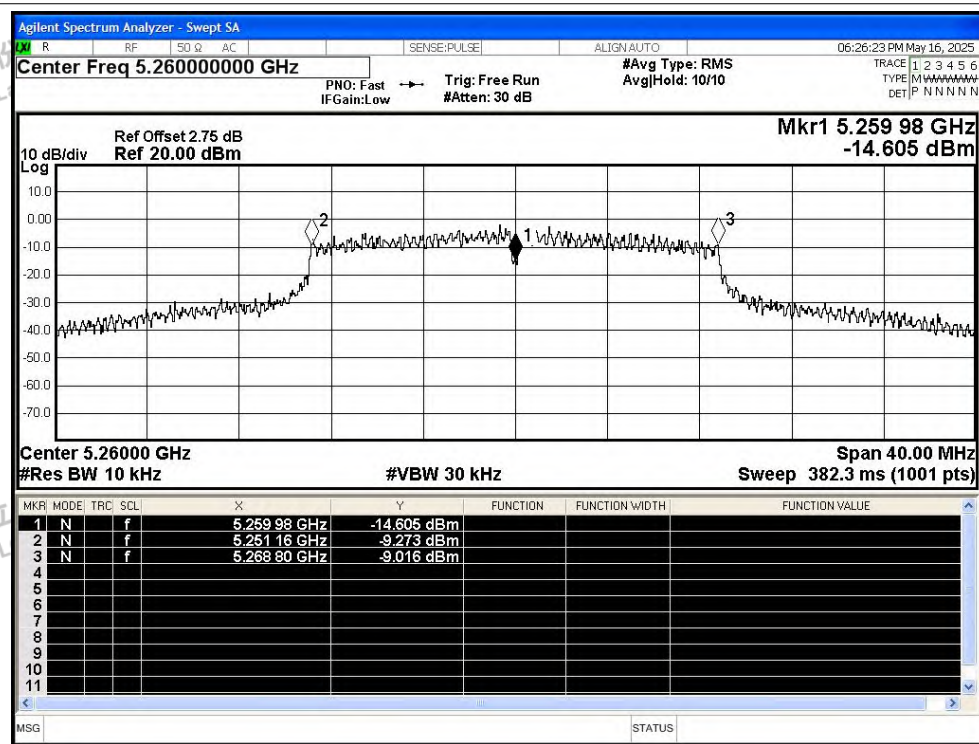

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant1

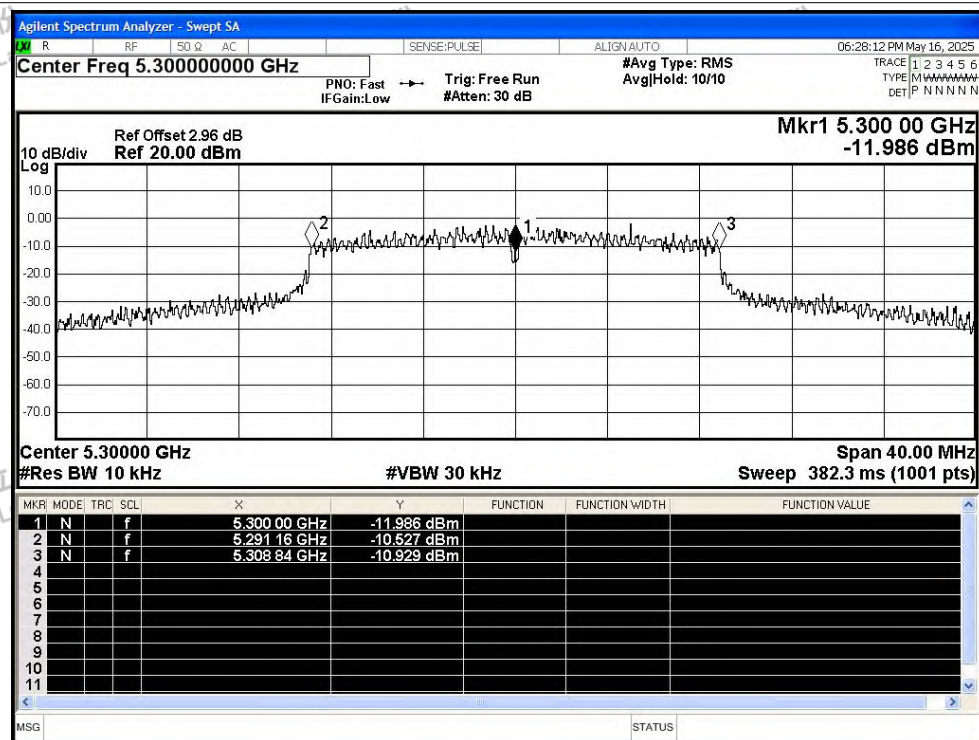

Freq. Stability NVNT n20 5320MHz Ant1

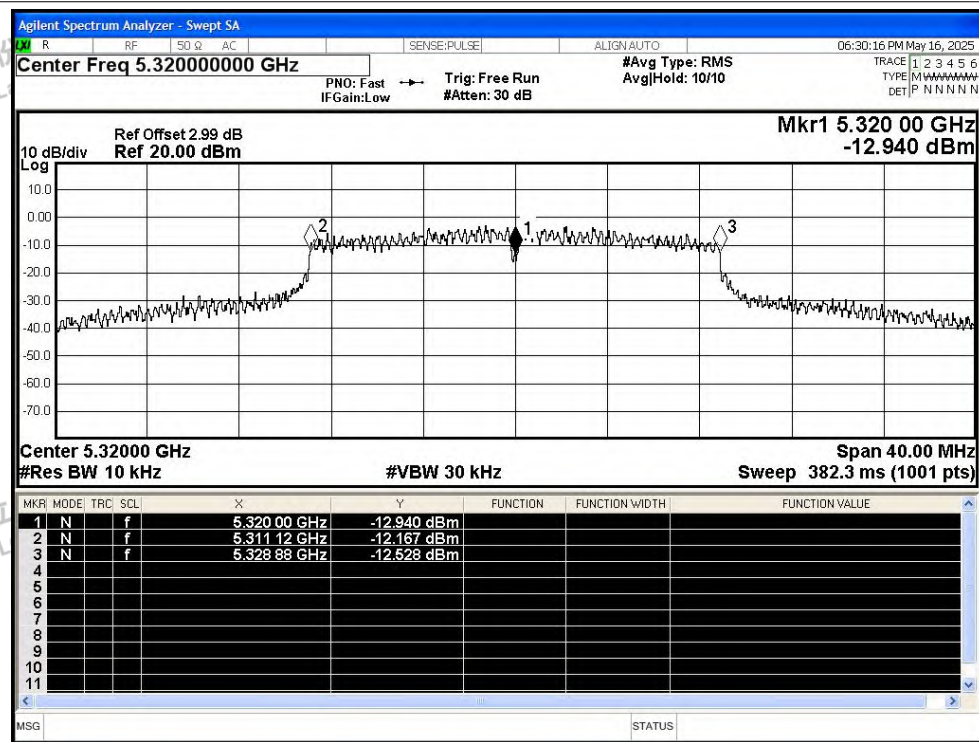

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

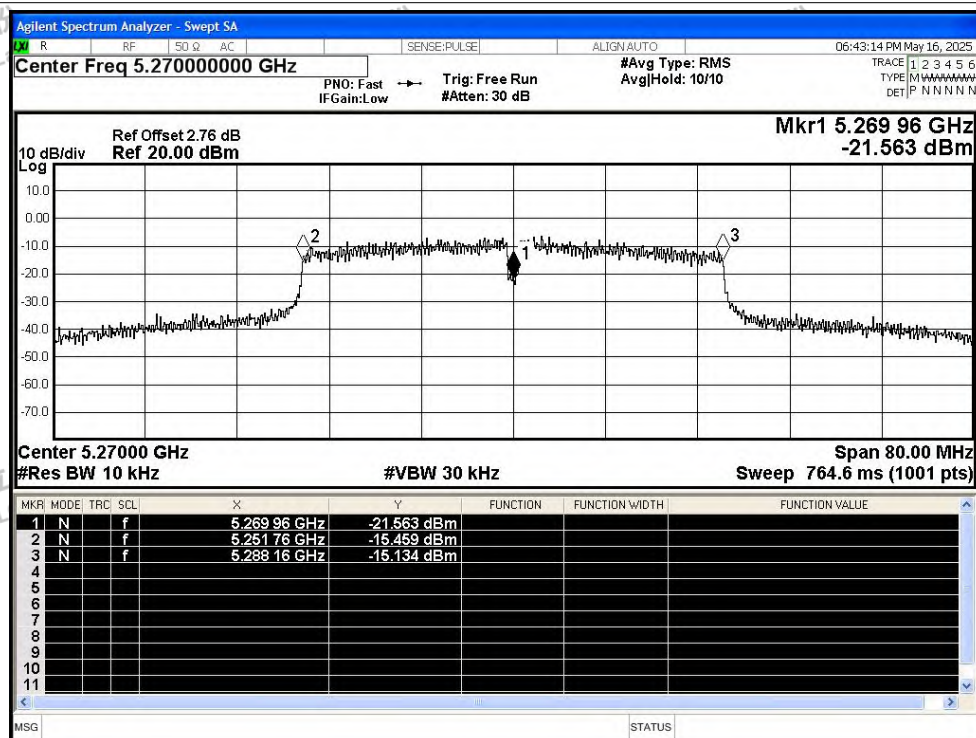

Freq. Stability NVNT n40 5310MHz Ant1

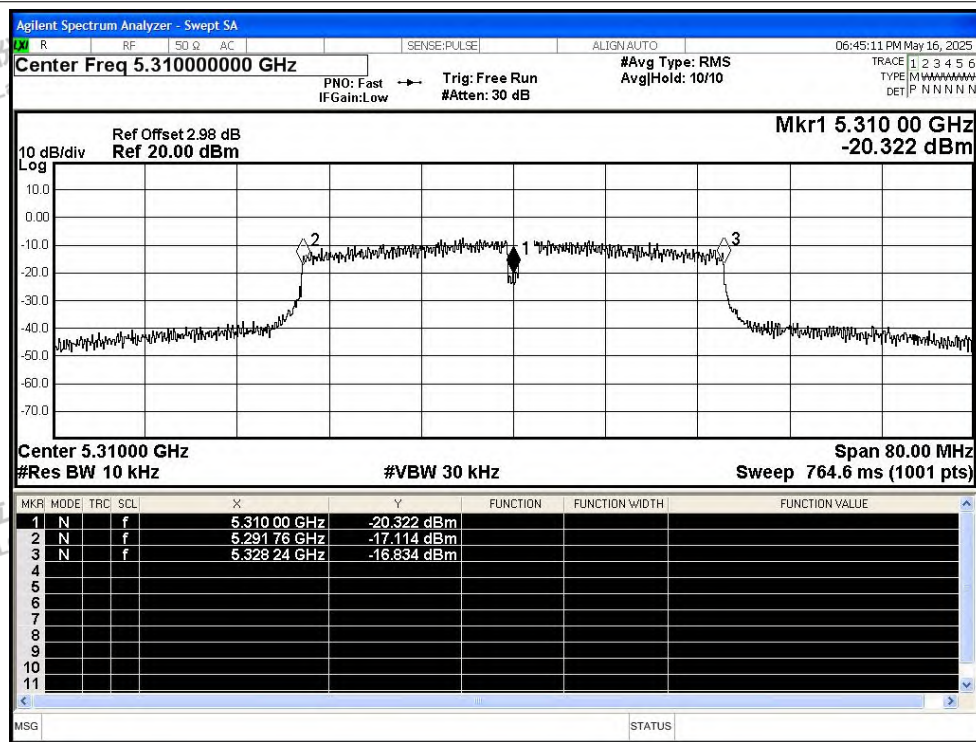

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

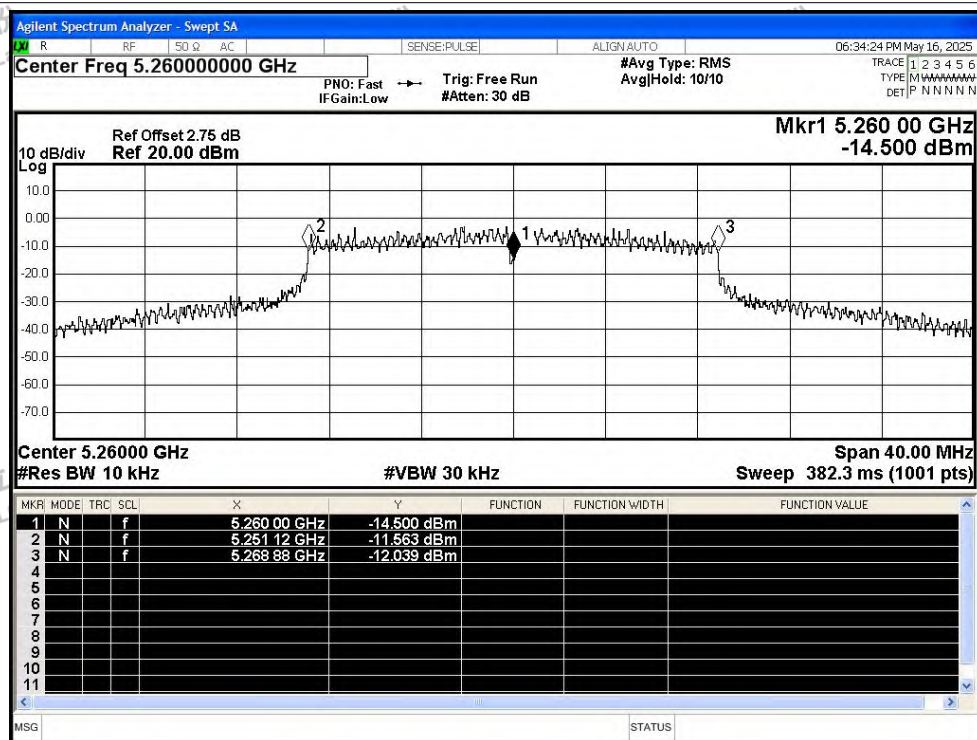

Freq. Stability NVNT ac20 5300MHz Ant1

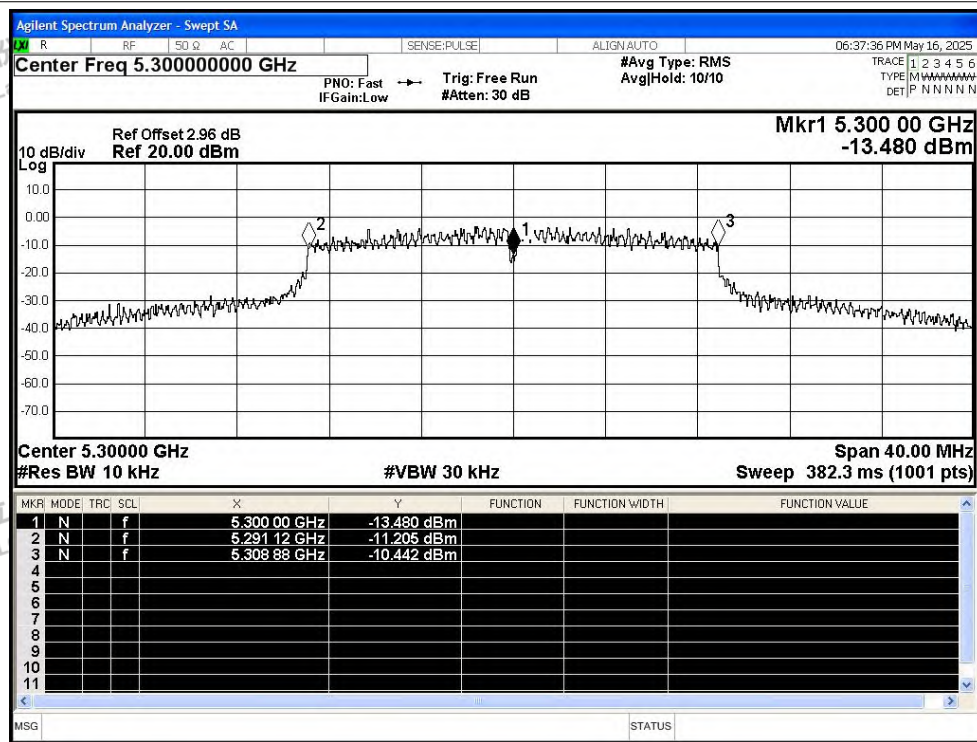

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

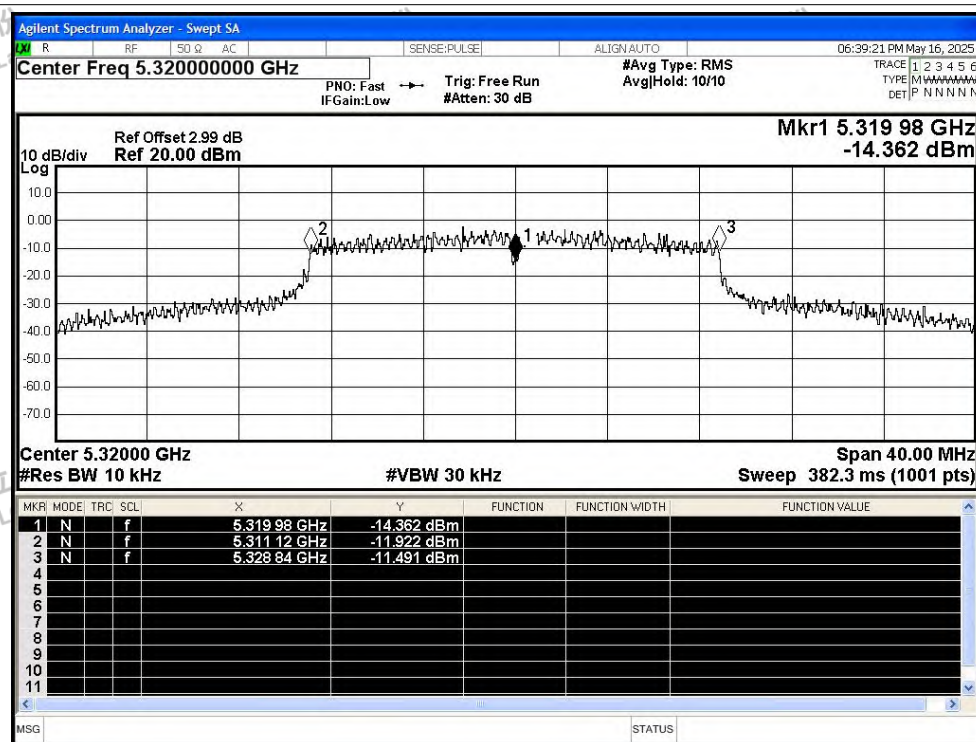

Freq. Stability NVNT ac40 5270MHz Ant1

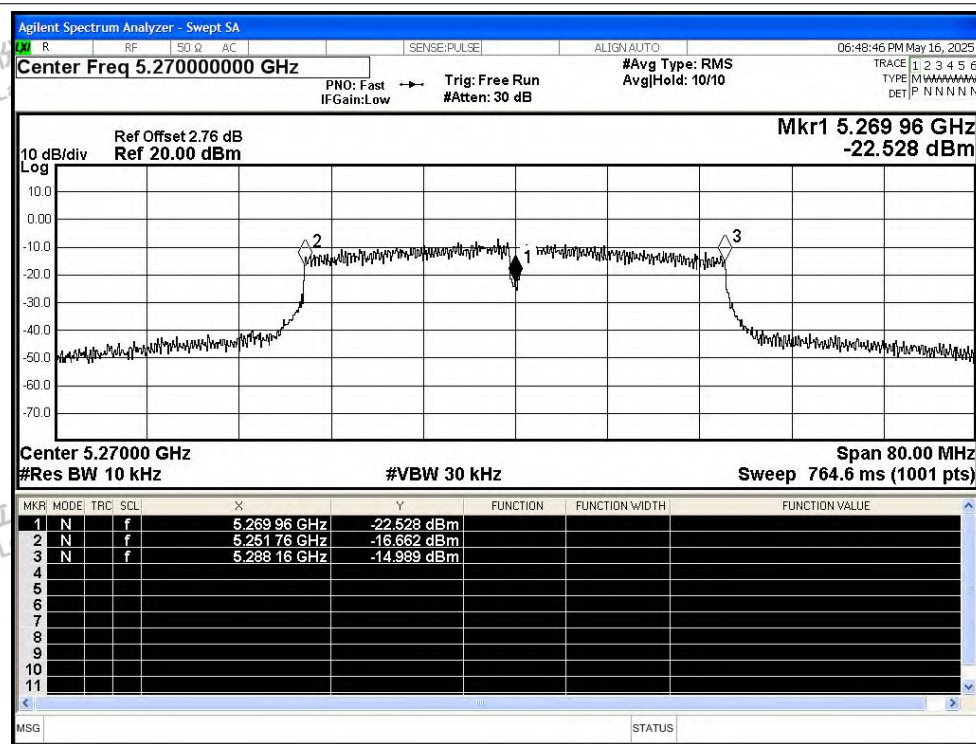

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

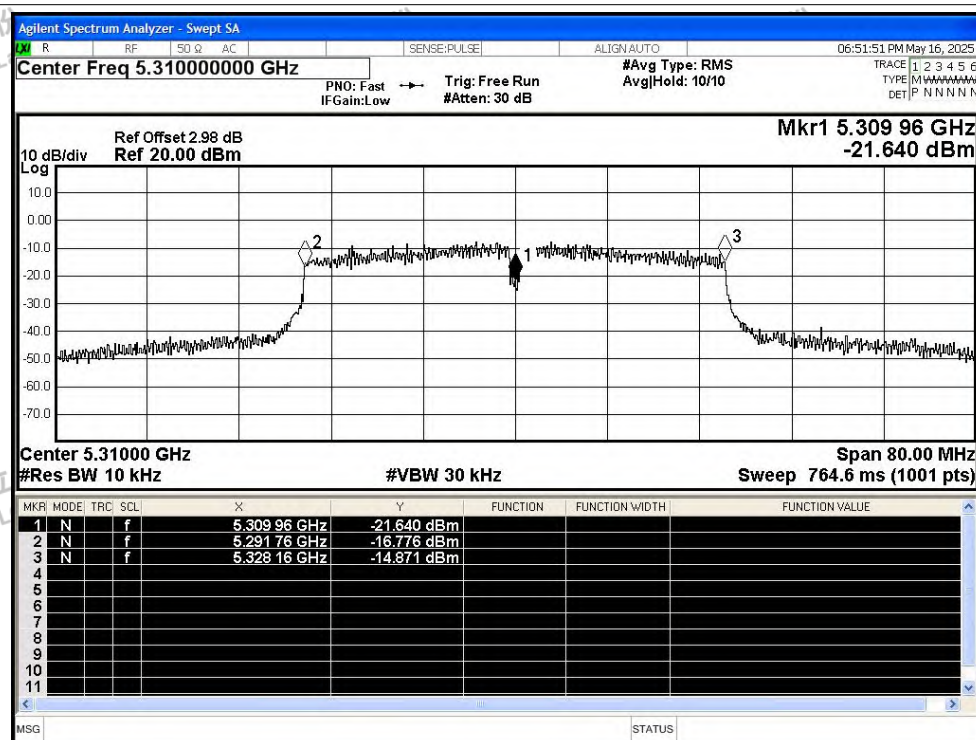

Freq. Stability NVNT ac80 5290MHz Ant1

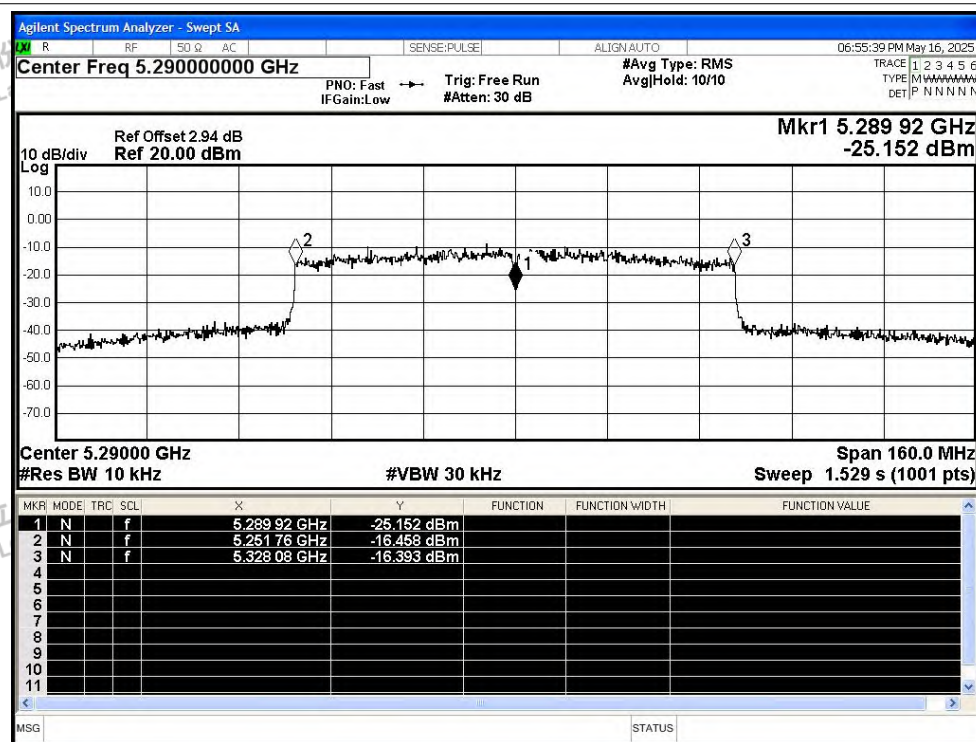

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5260	0	0	25	Pass
NVNT	a	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	a	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n20	5260	Ant2	5259.96	-40000	-7.6	25	Pass
NVNT	n20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	n20	5320	Ant2	5319.98	-20000	-3.76	25	Pass
NVNT	n40	5270	Ant2	5270	0	0	25	Pass
NVNT	n40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac20	5260	Ant2	5260	0	0	25	Pass
NVNT	ac20	5300	Ant2	5299.98	-20000	-3.77	25	Pass
NVNT	ac20	5320	Ant2	5319.96	-40000	-7.52	25	Pass
NVNT	ac40	5270	Ant2	5270	0	0	25	Pass
NVNT	ac40	5310	Ant2	5310	0	0	25	Pass
NVNT	ac80	5290	Ant2	5290	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

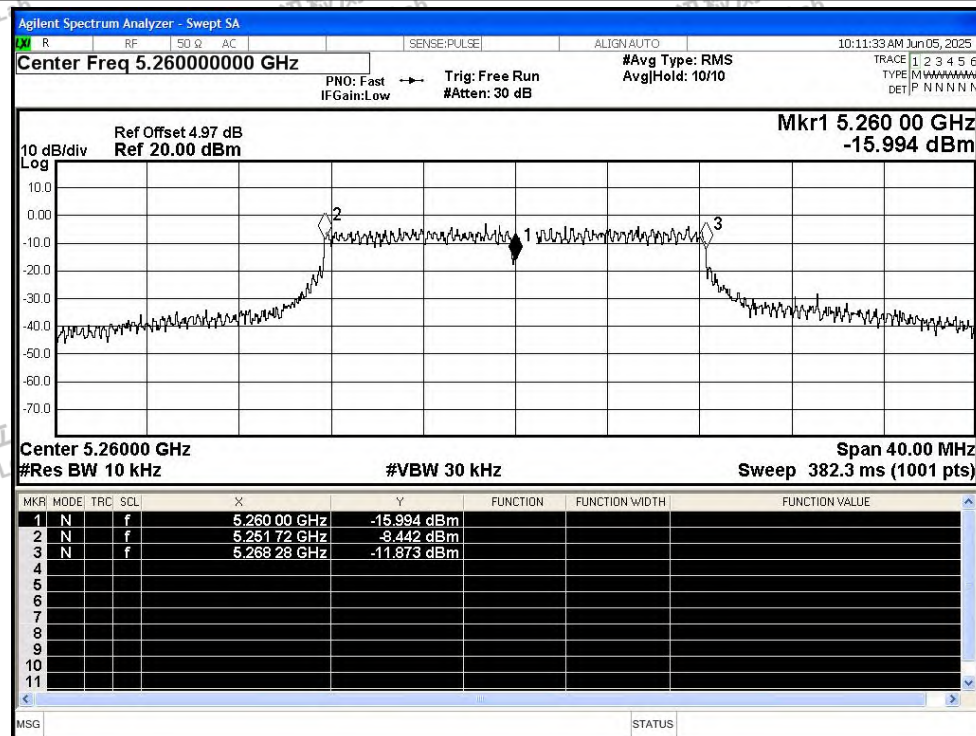

Freq. Stability NVNT a 5300MHz Ant2

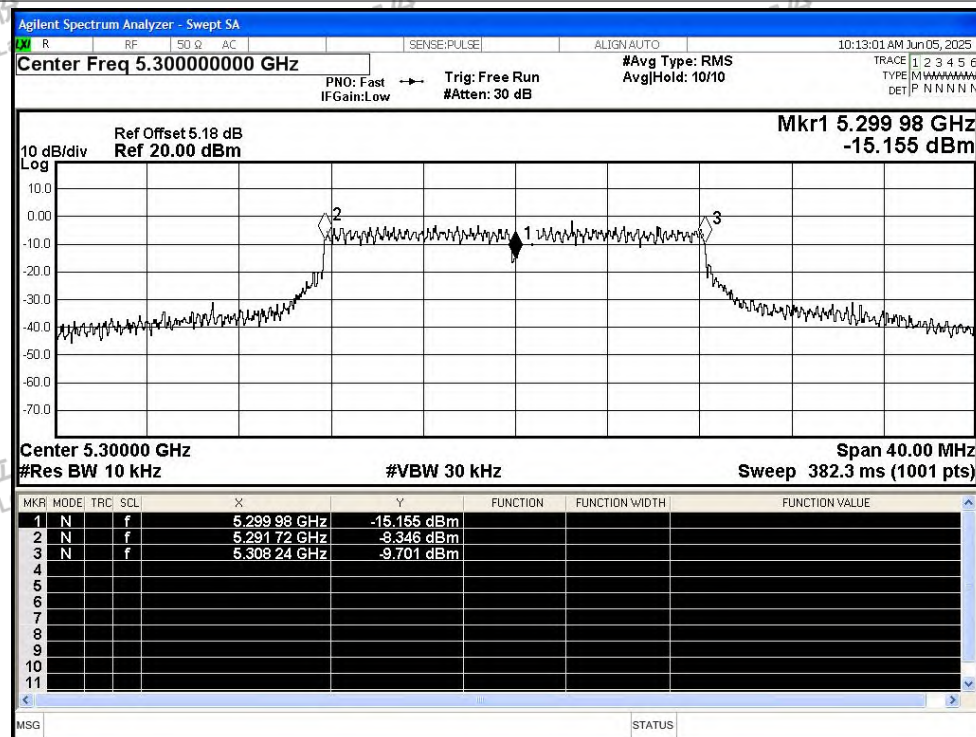

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant2

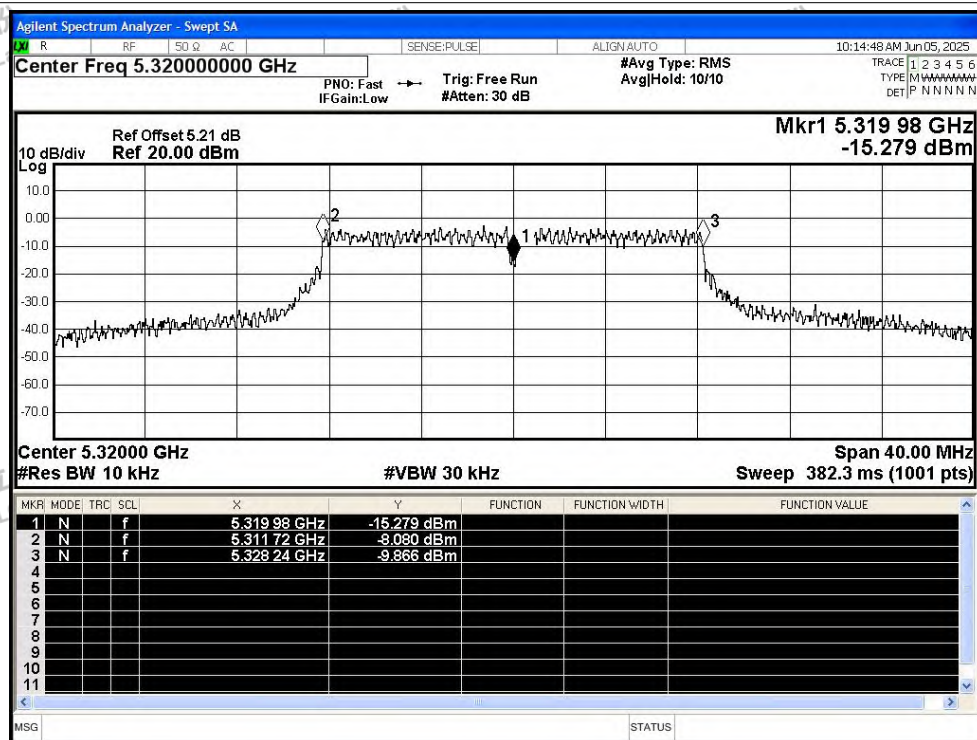

Freq. Stability NVNT n20 5260MHz Ant2

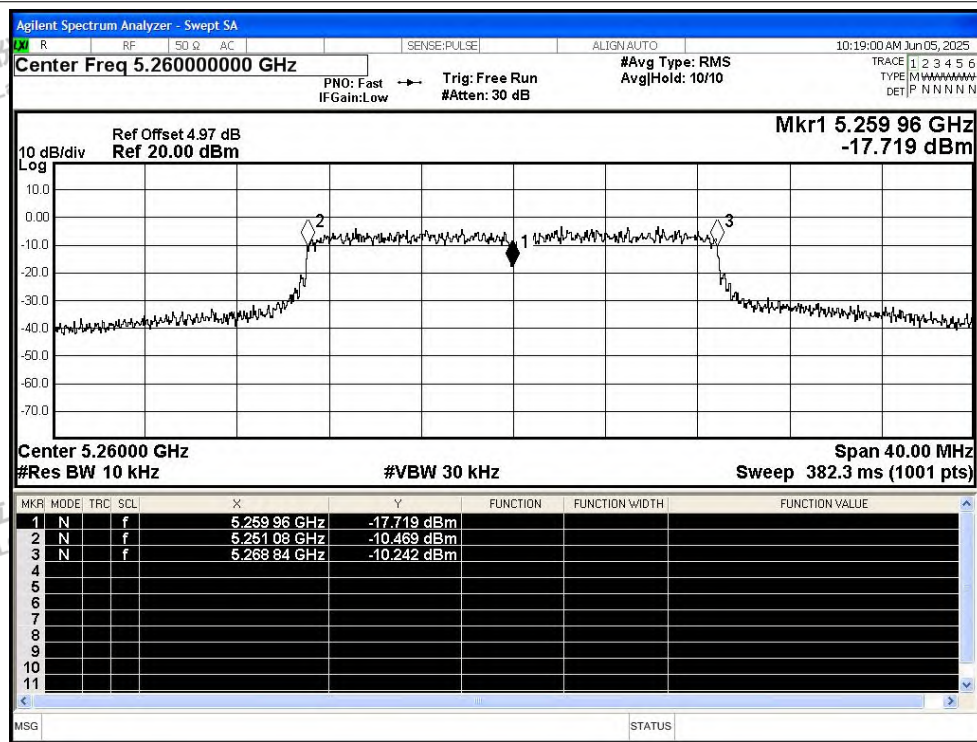

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant2

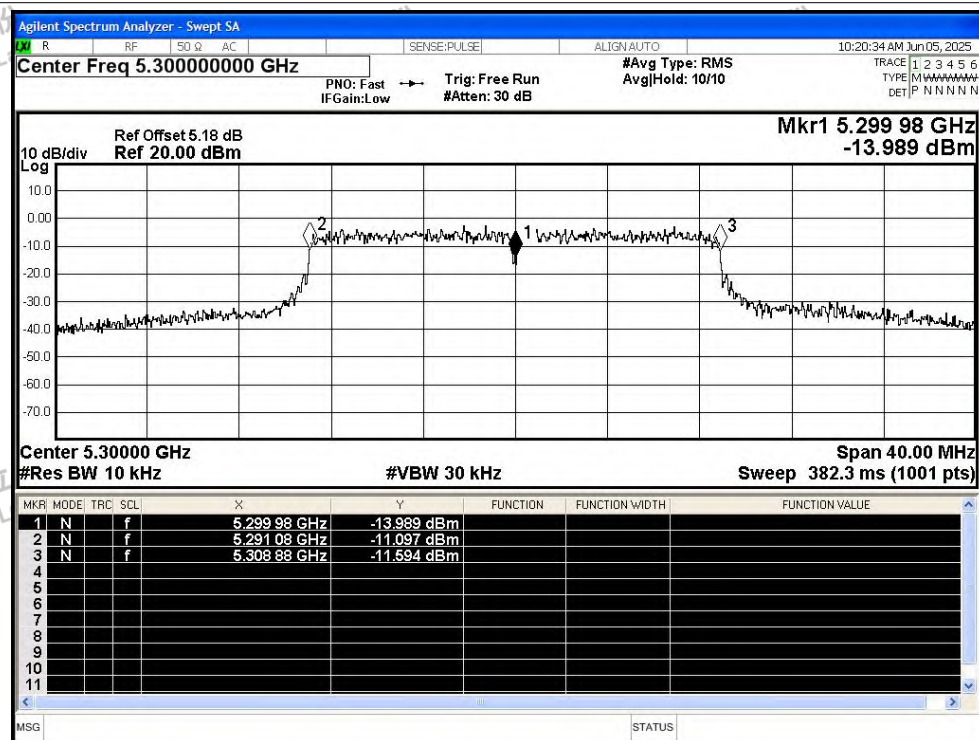

Freq. Stability NVNT n20 5320MHz Ant2

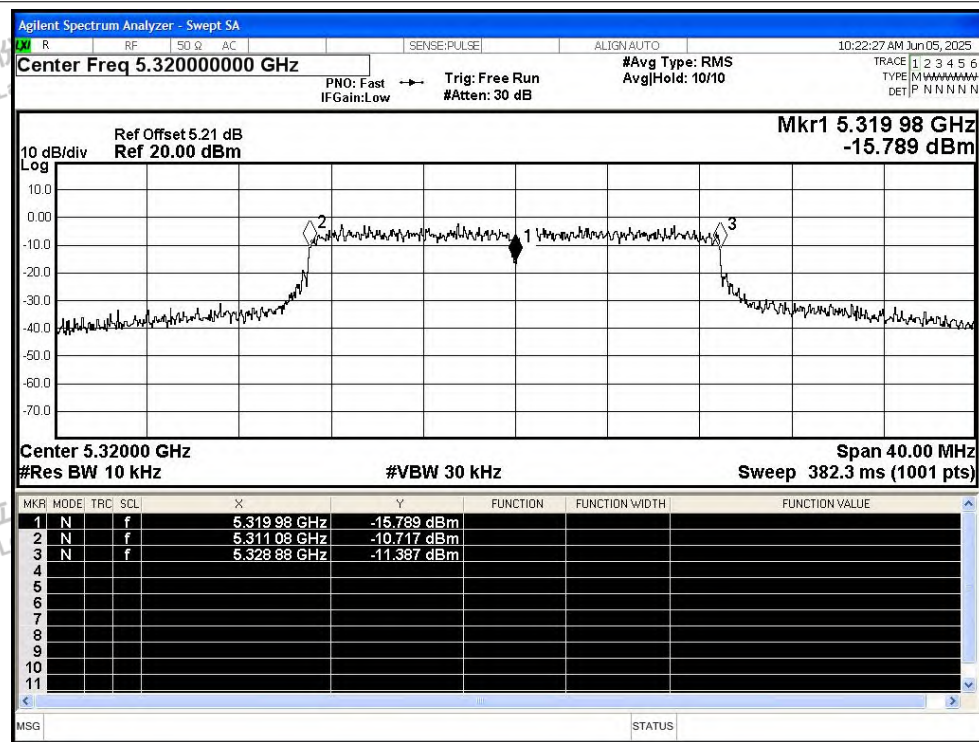

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant2

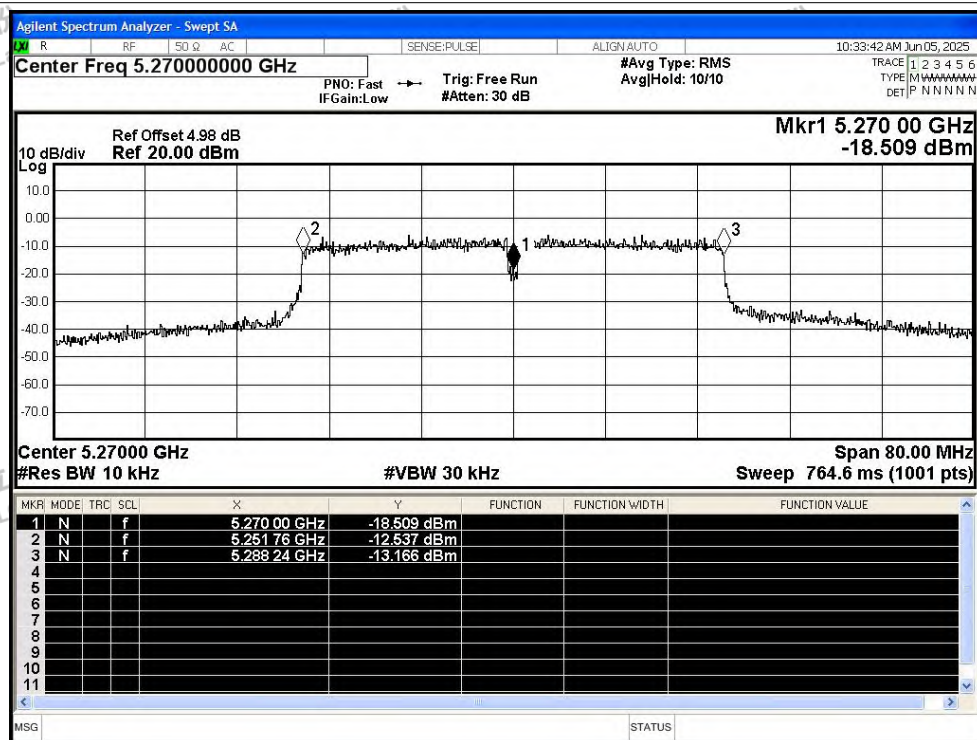

Freq. Stability NVNT n40 5310MHz Ant2

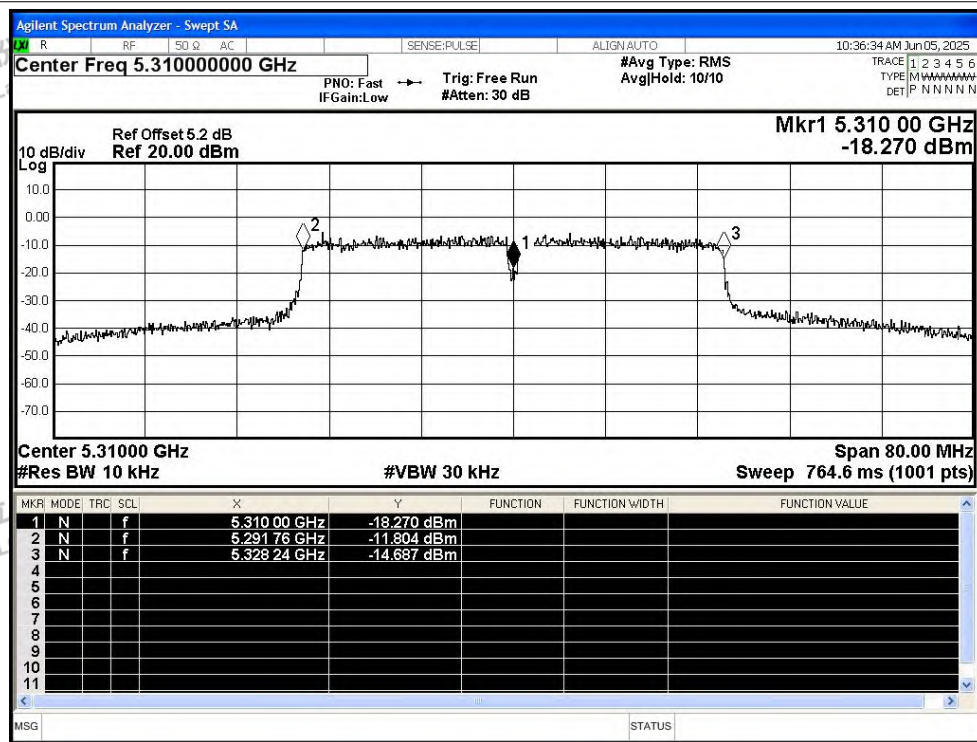

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant2

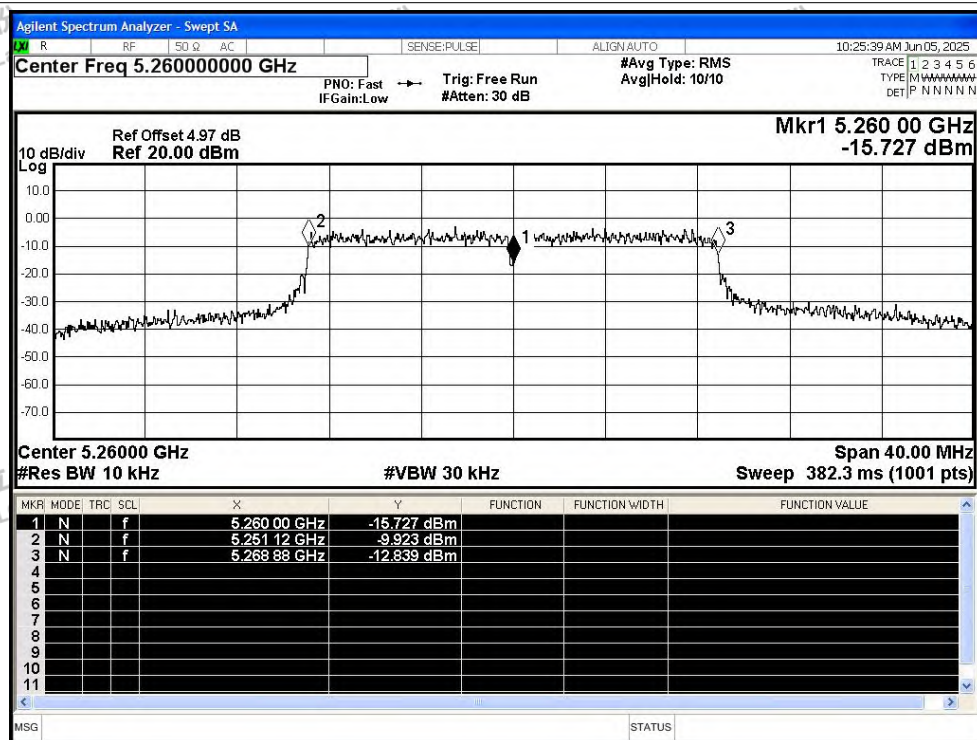

Freq. Stability NVNT ac20 5300MHz Ant2

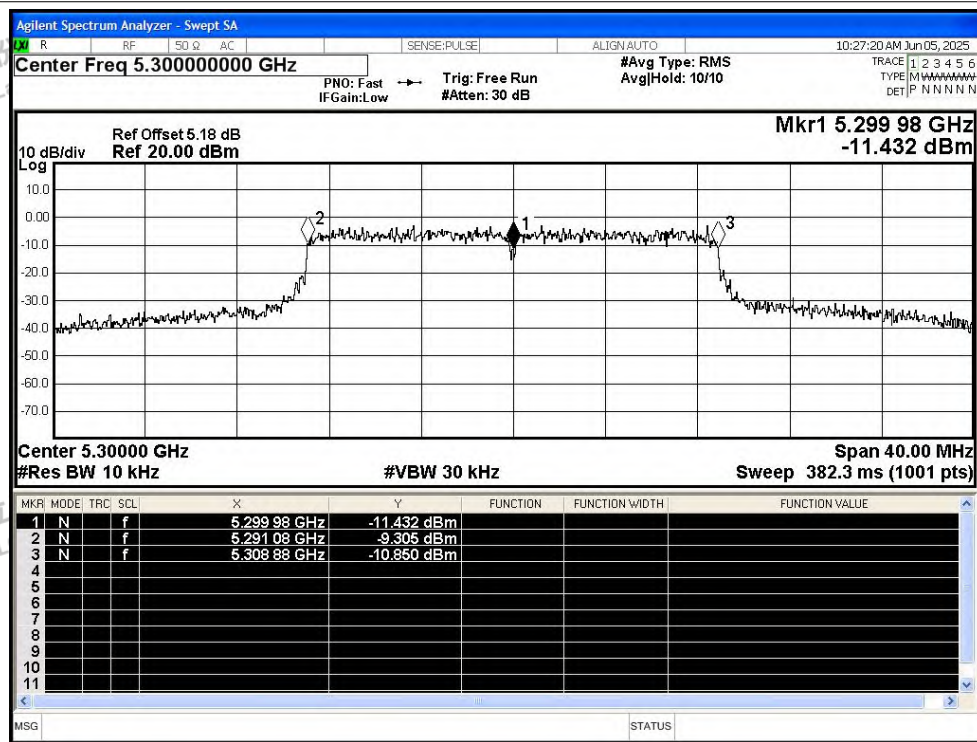

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

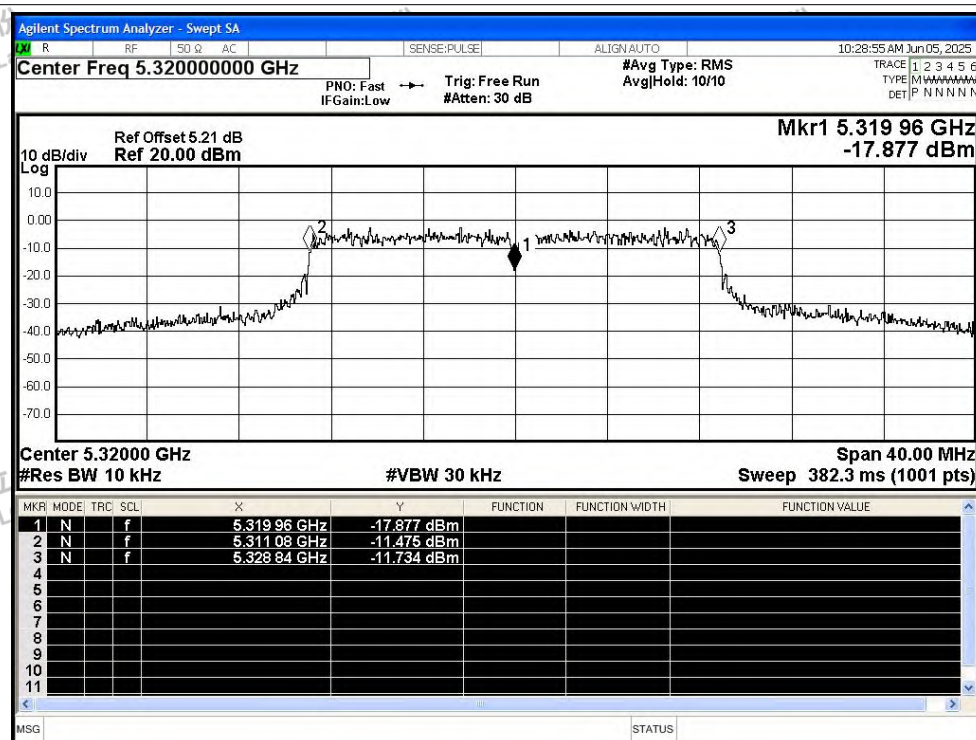

Freq. Stability NVNT ac40 5270MHz Ant2

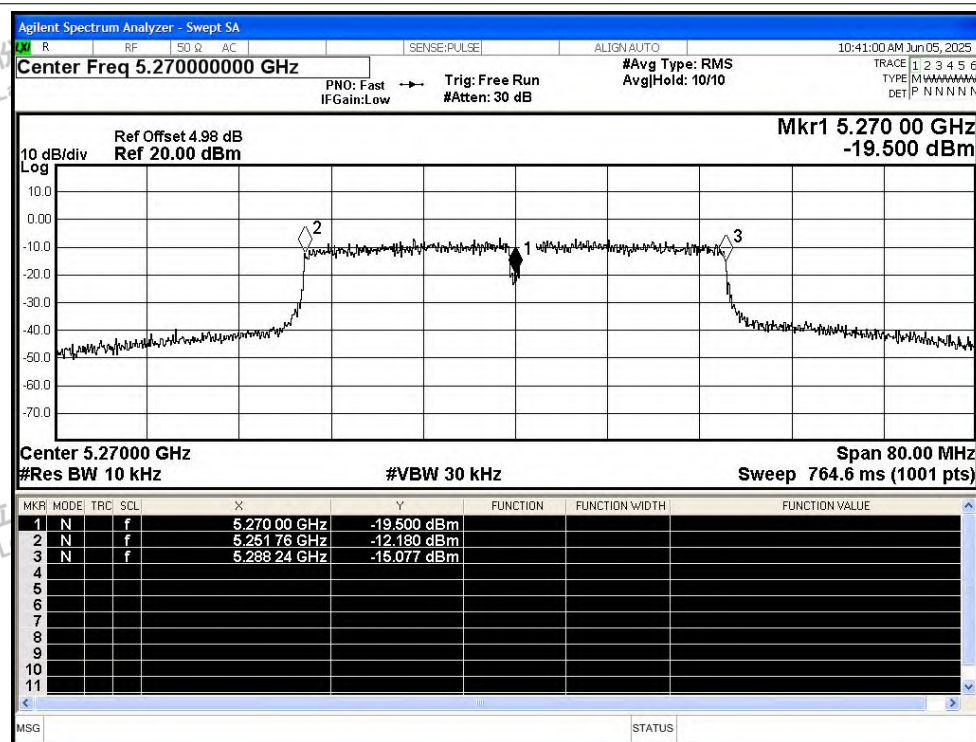

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant2

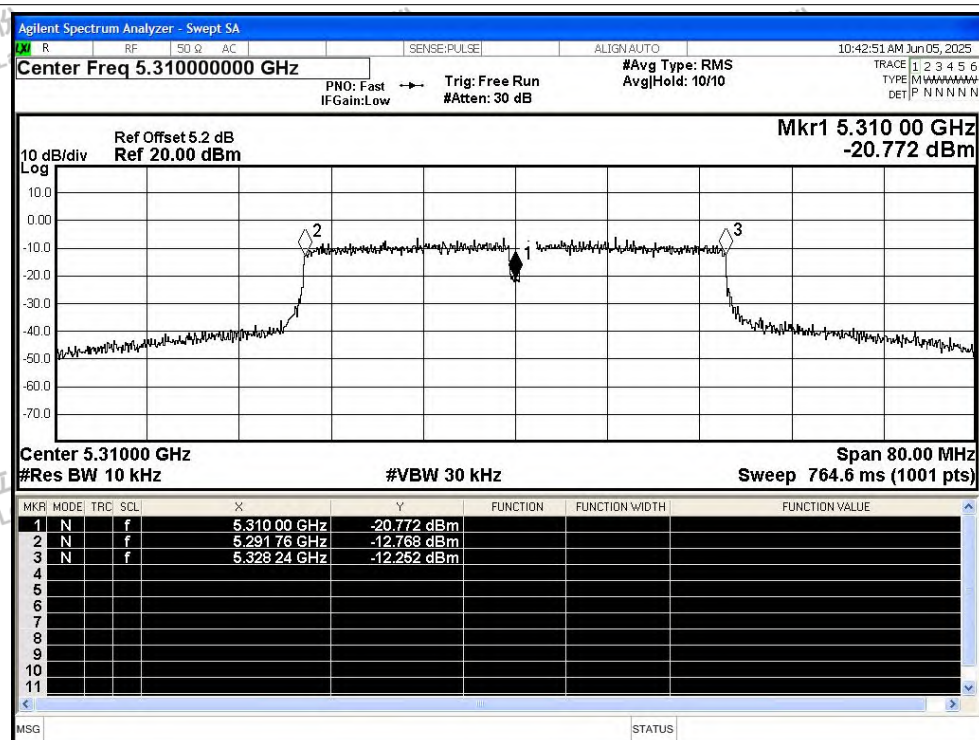

Freq. Stability NVNT ac80 5290MHz Ant2

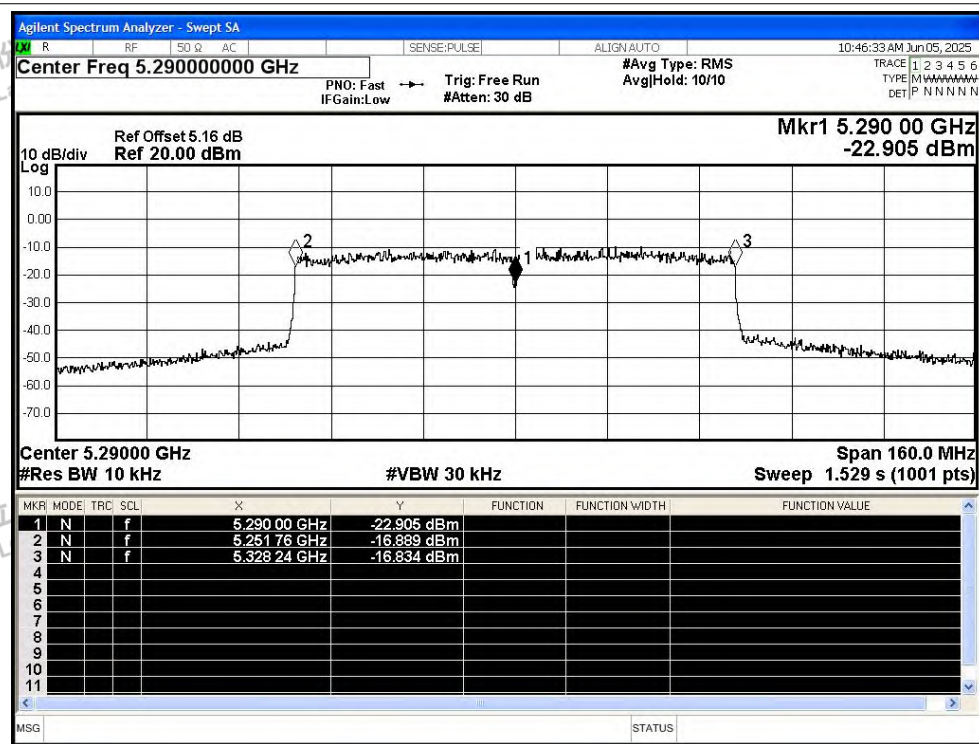

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	97.01	0.13	0.72
NVNT	a	5300	Ant1	96.94	0.13	0.72
NVNT	a	5320	Ant1	97.01	0.13	0.72
NVNT	n20	5260	Ant1	96.88	0.14	0.77
NVNT	n20	5300	Ant1	96.8	0.14	0.77
NVNT	n20	5320	Ant1	96.8	0.14	0.77
NVNT	n40	5270	Ant1	93.79	0.28	1.54
NVNT	n40	5310	Ant1	93.79	0.28	1.54
NVNT	ac20	5260	Ant1	96.83	0.14	0.76
NVNT	ac20	5300	Ant1	96.76	0.14	0.76
NVNT	ac20	5320	Ant1	96.76	0.14	0.76
NVNT	ac40	5270	Ant1	93.82	0.28	1.53
NVNT	ac40	5310	Ant1	93.82	0.28	1.53
NVNT	ac80	5290	Ant1	88.32	0.54	3.08






Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

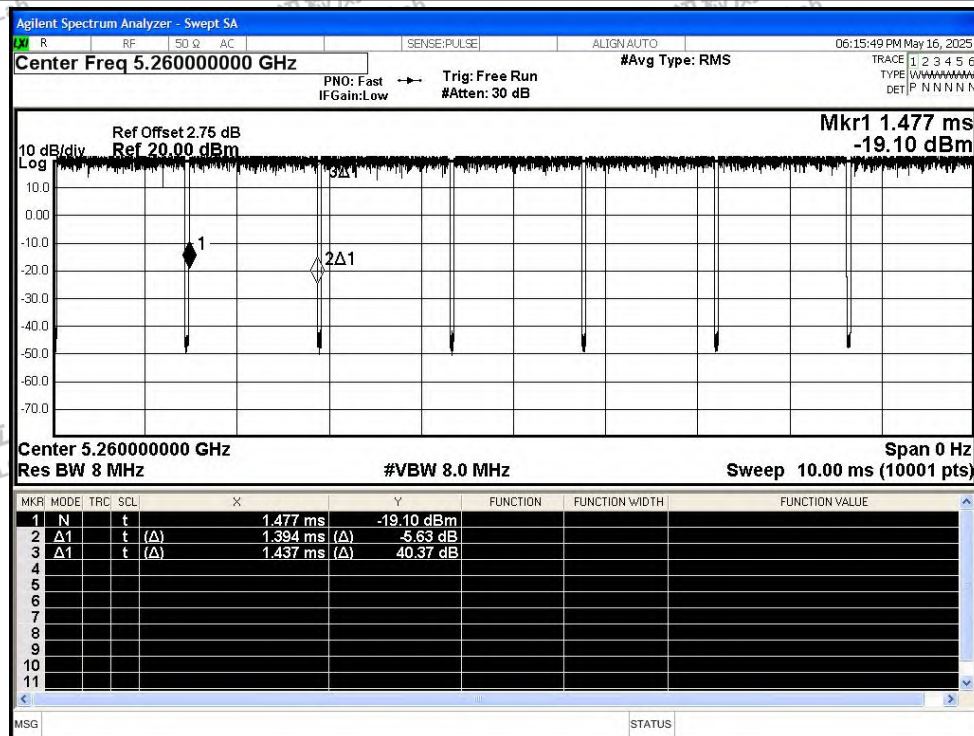

Duty Cycle NVNT a 5300MHz Ant1

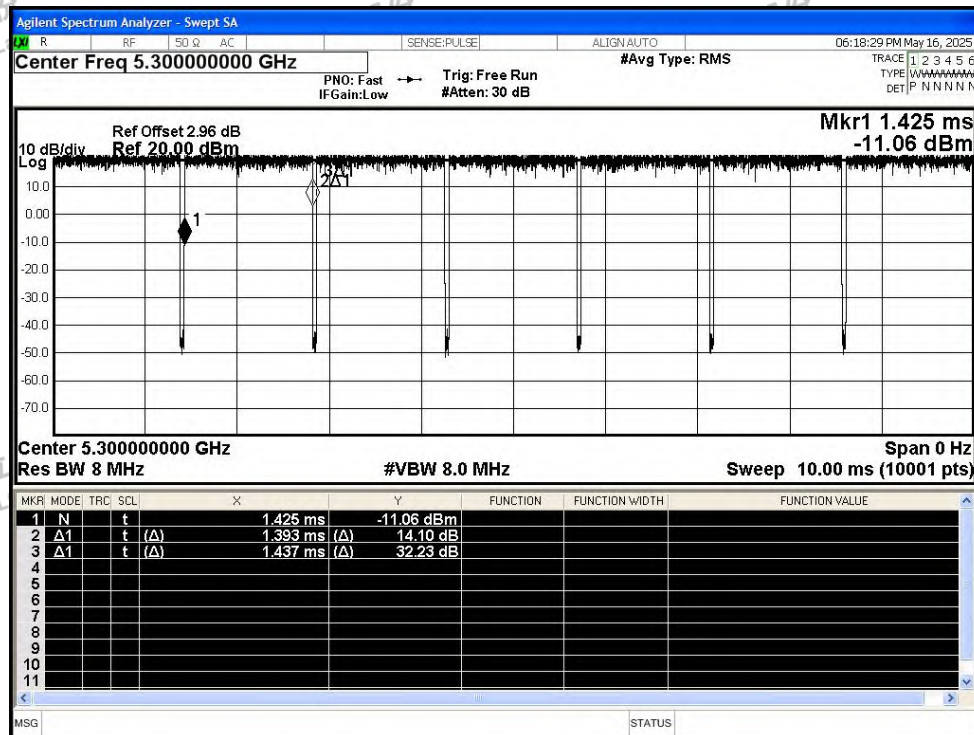

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

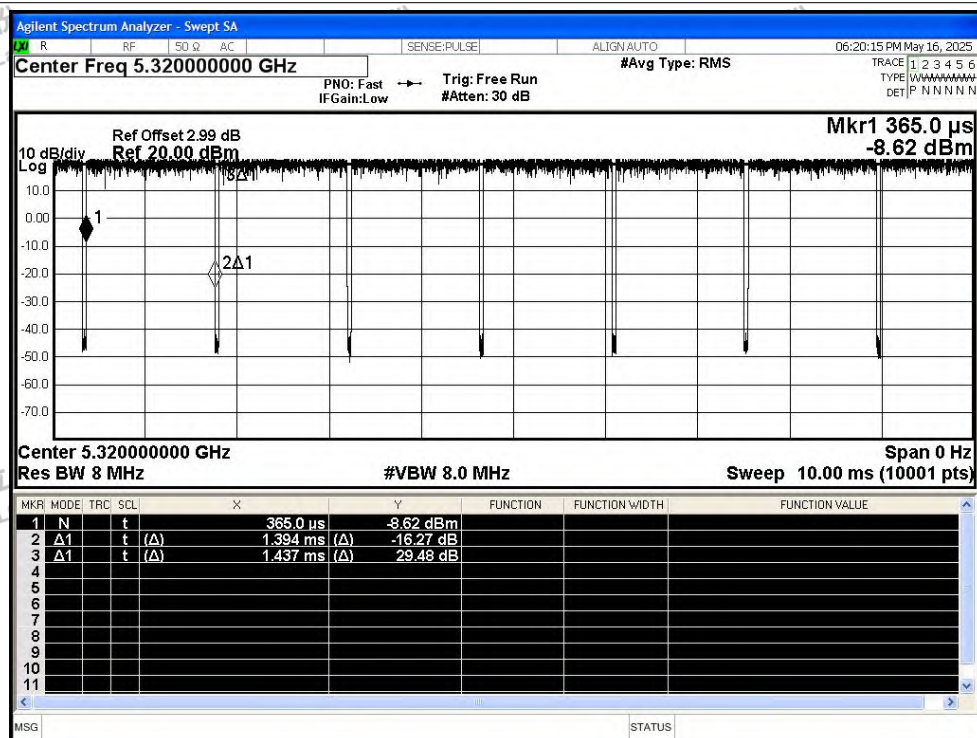

Duty Cycle NVNT n20 5260MHz Ant1

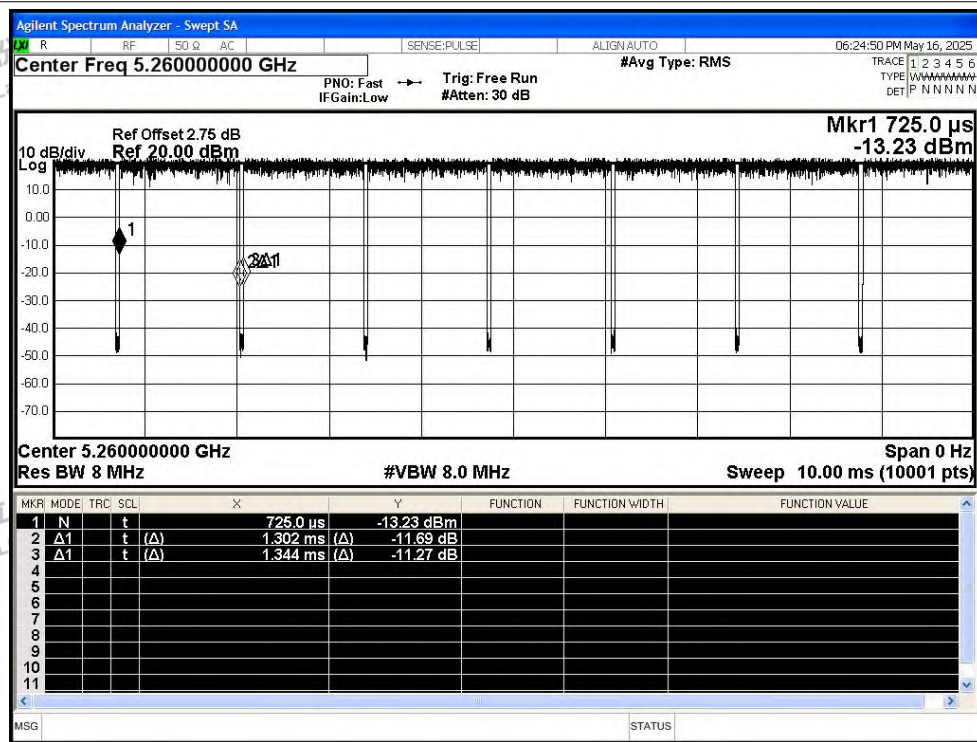

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant1

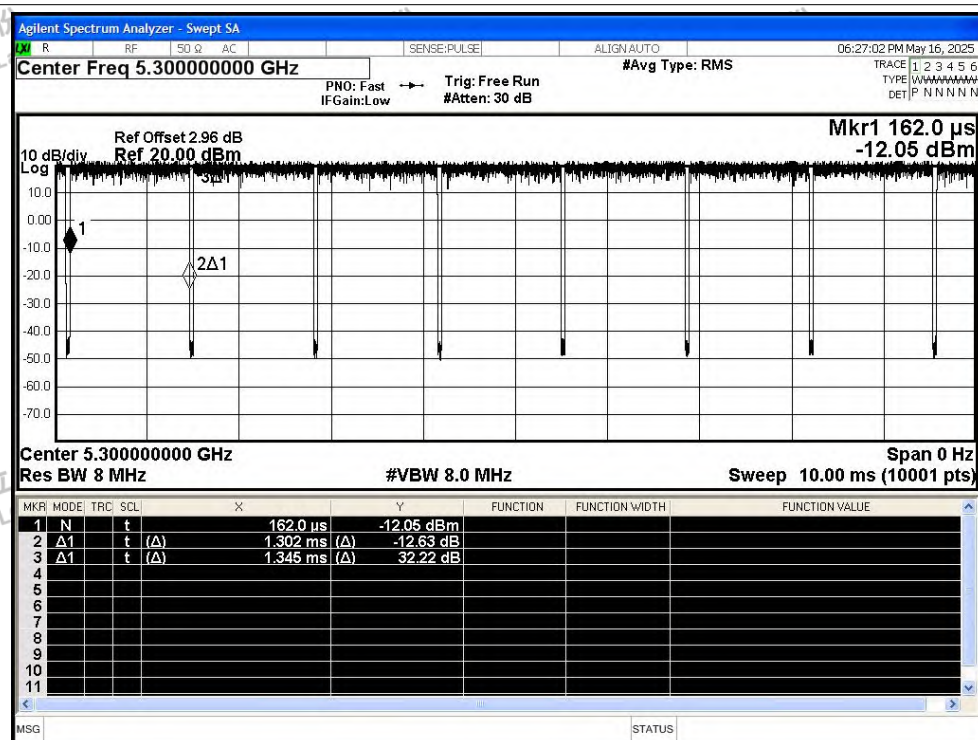

Duty Cycle NVNT n20 5320MHz Ant1

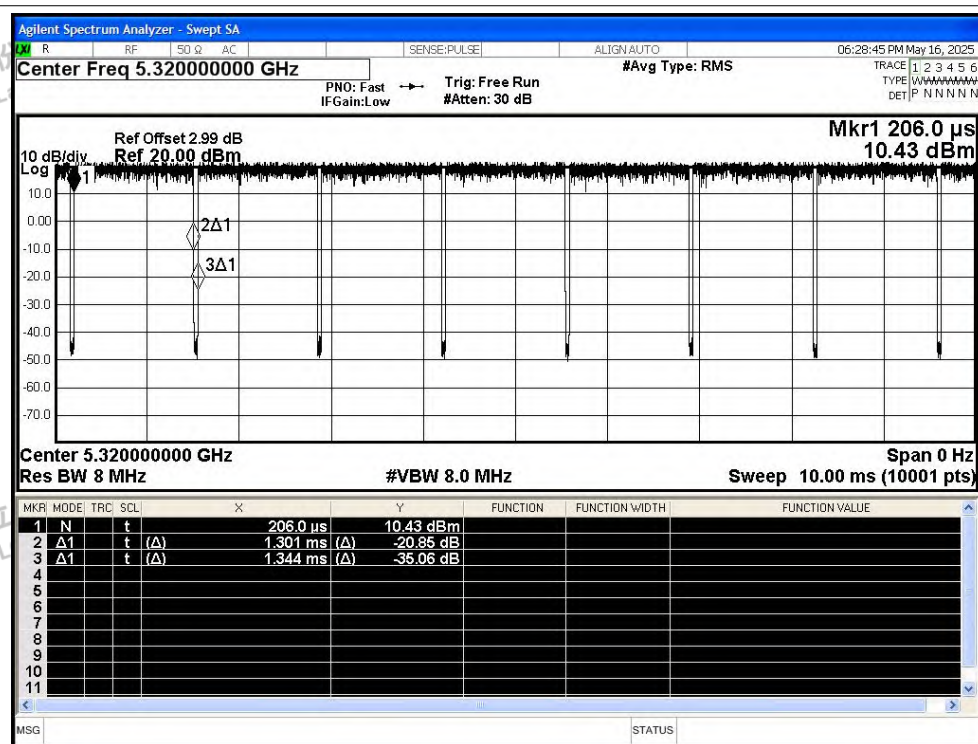

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant1

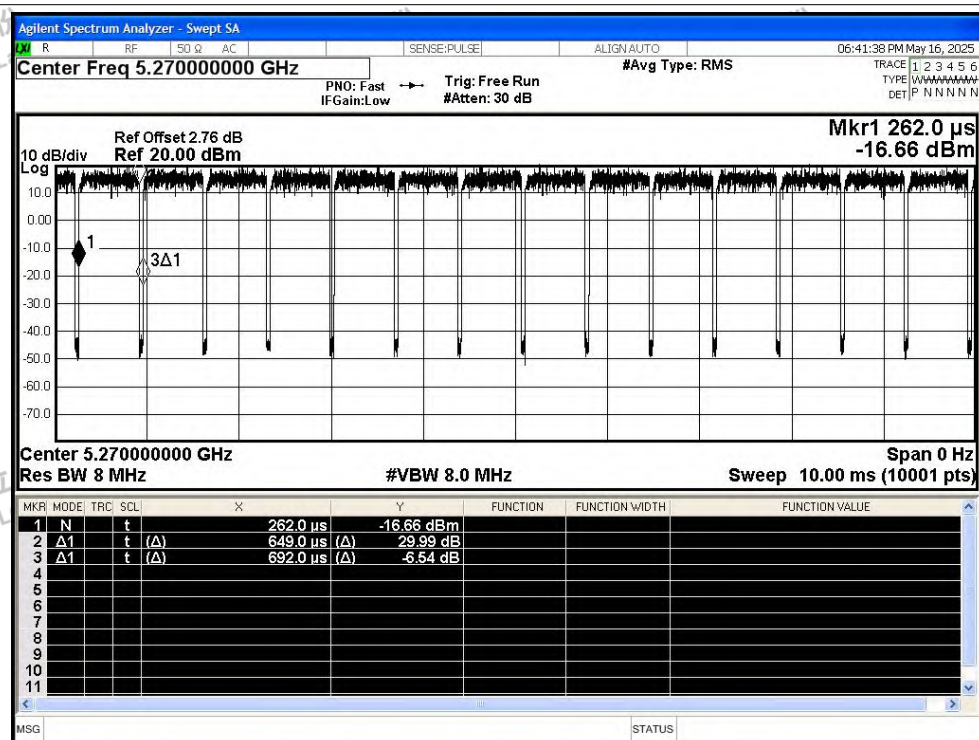

Duty Cycle NVNT n40 5310MHz Ant1

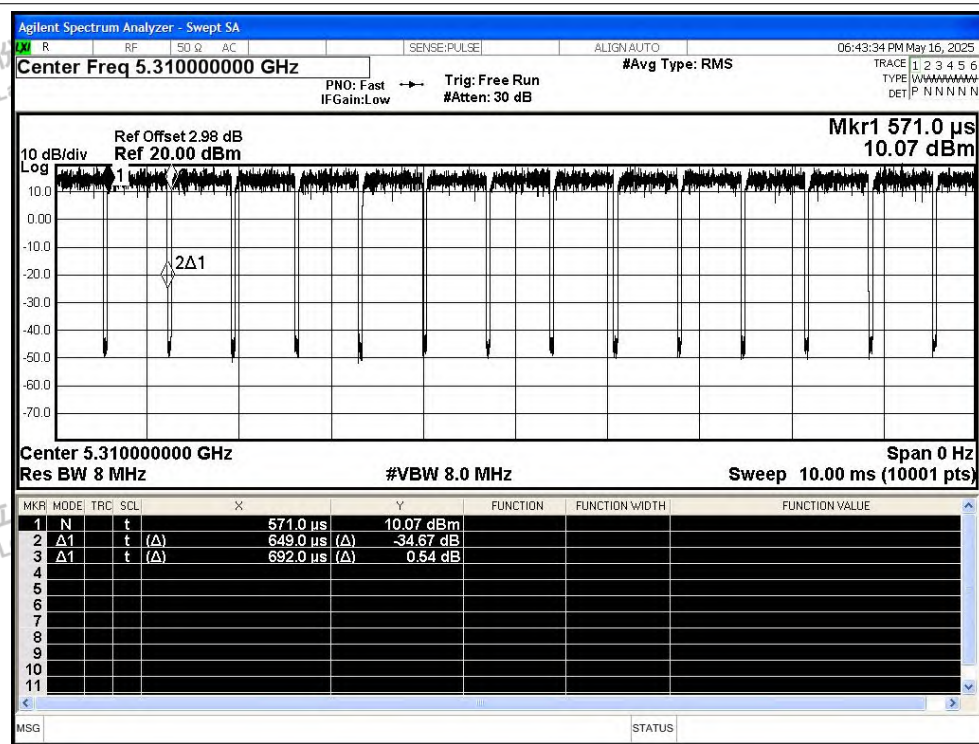

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

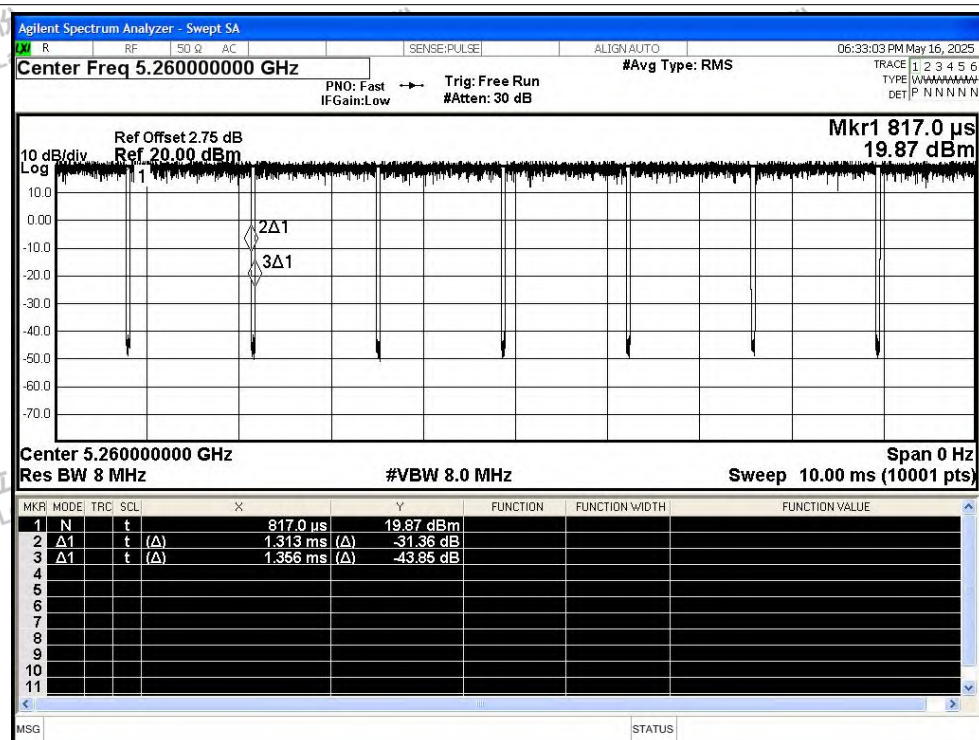

Duty Cycle NVNT ac20 5300MHz Ant1

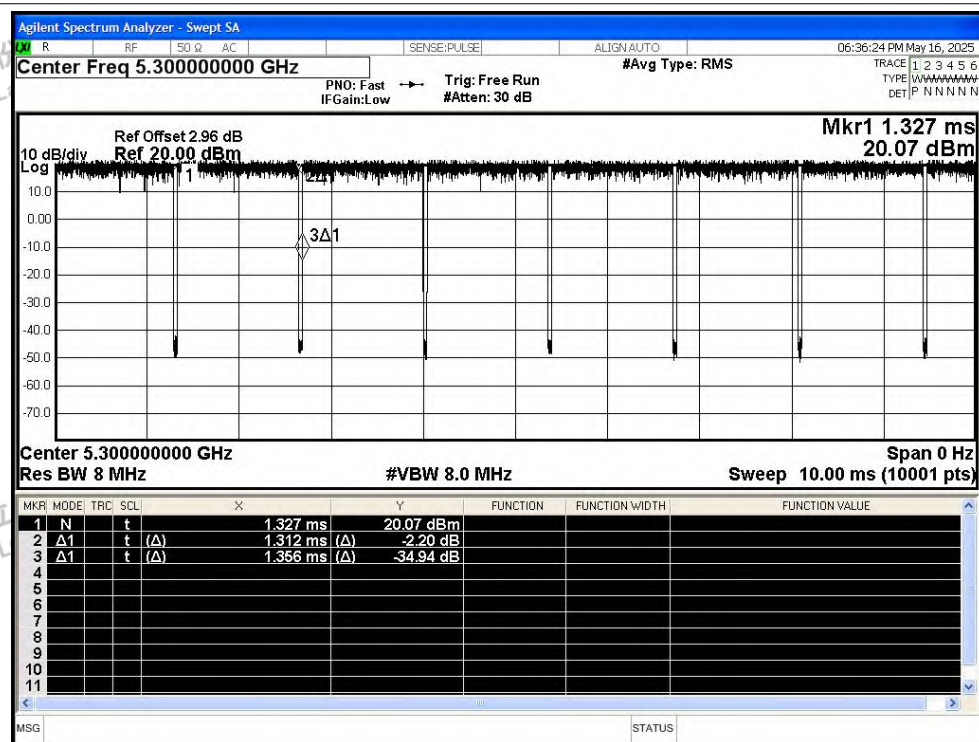

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

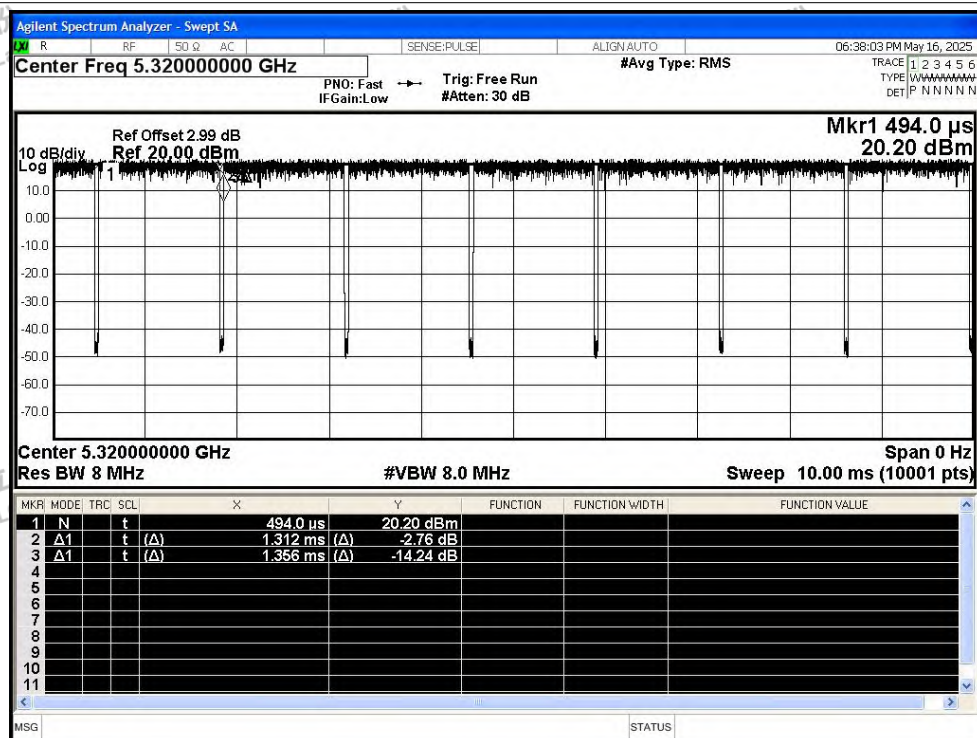

Duty Cycle NVNT ac40 5270MHz Ant1

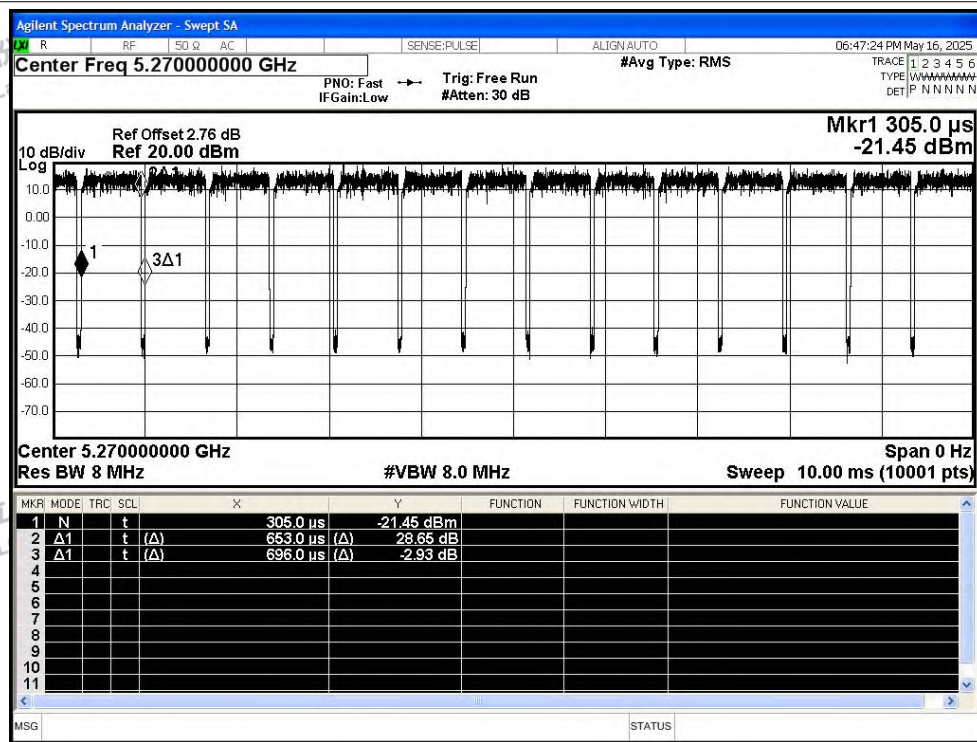

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant1

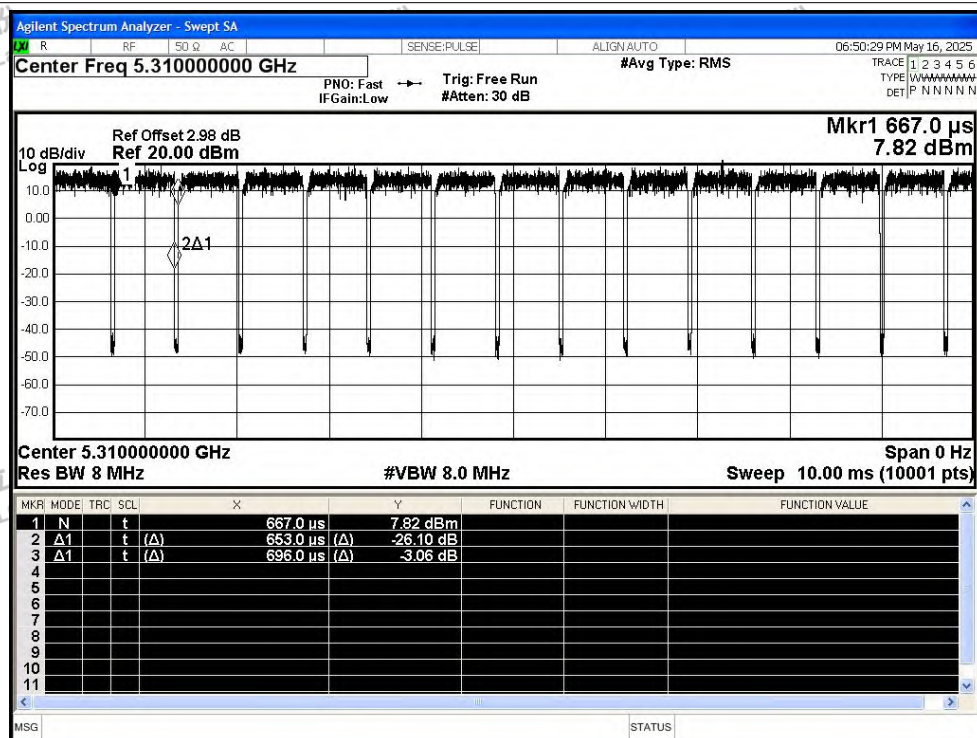

Duty Cycle NVNT ac80 5290MHz Ant1

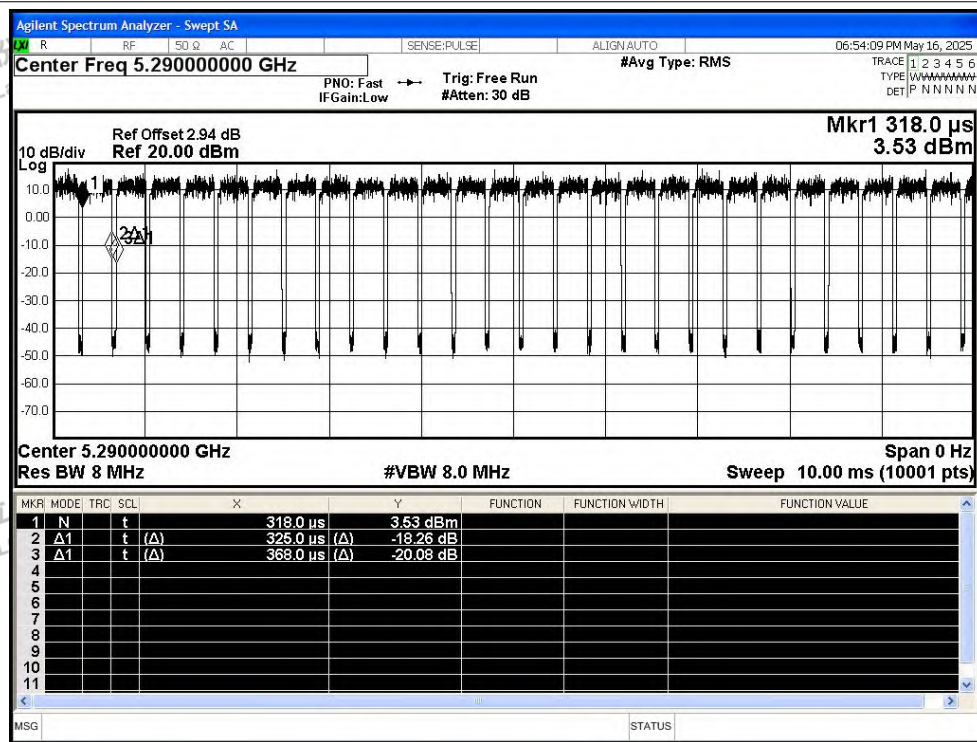

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant2	95.75	0.19	0.72
NVNT	a	5300	Ant2	95.75	0.19	0.72
NVNT	a	5320	Ant2	95.68	0.19	0.72
NVNT	n20	5260	Ant2	94.94	0.23	0.85
NVNT	n20	5300	Ant2	94.94	0.23	0.85
NVNT	n20	5320	Ant2	95.02	0.22	0.85
NVNT	n40	5270	Ant2	90.45	0.44	1.7
NVNT	n40	5310	Ant2	90.45	0.44	1.7
NVNT	ac20	5260	Ant2	95.04	0.22	0.84
NVNT	ac20	5300	Ant2	95.04	0.22	0.84
NVNT	ac20	5320	Ant2	95.04	0.22	0.84
NVNT	ac40	5270	Ant2	90.56	0.43	1.68
NVNT	ac40	5310	Ant2	90.56	0.43	1.68
NVNT	ac80	5290	Ant2	82.68	0.83	3.38



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant2

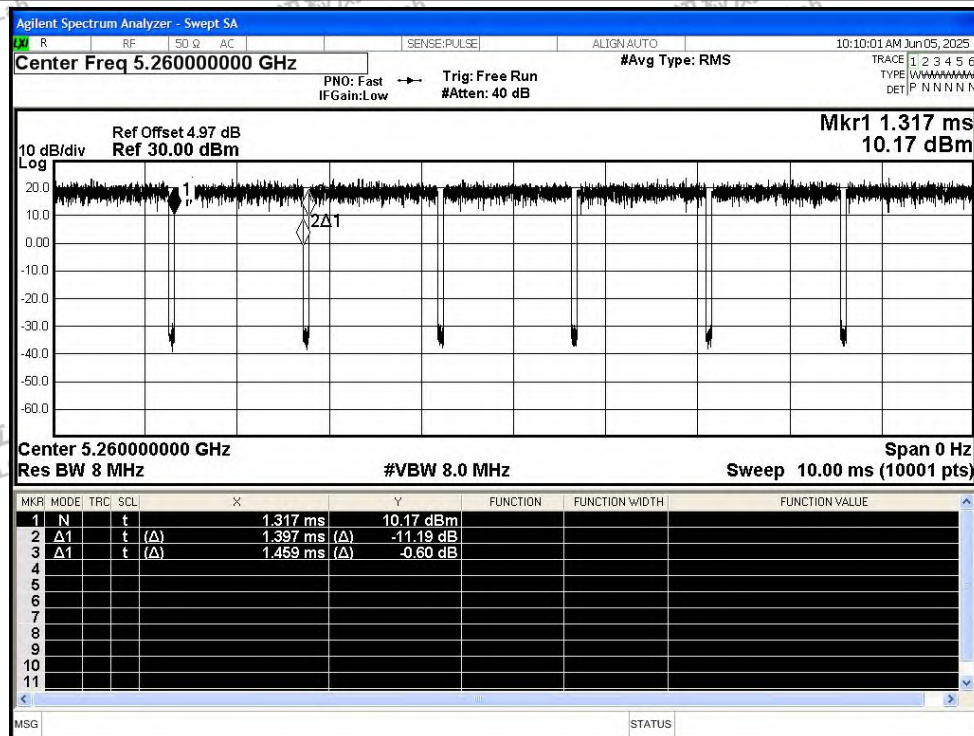

Duty Cycle NVNT a 5300MHz Ant2

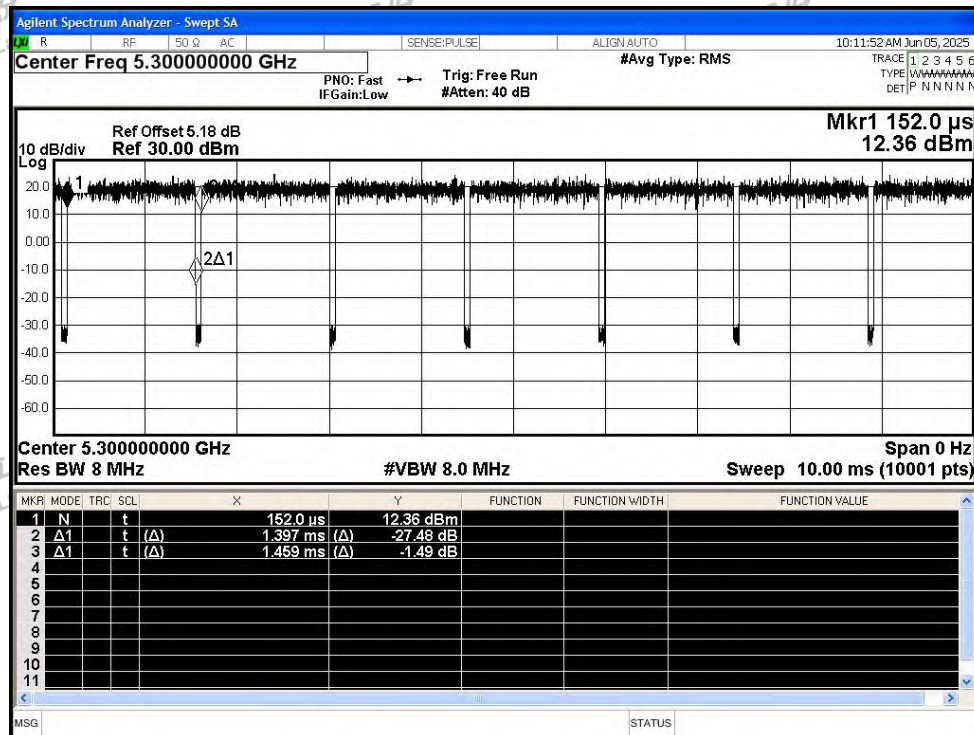

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant2

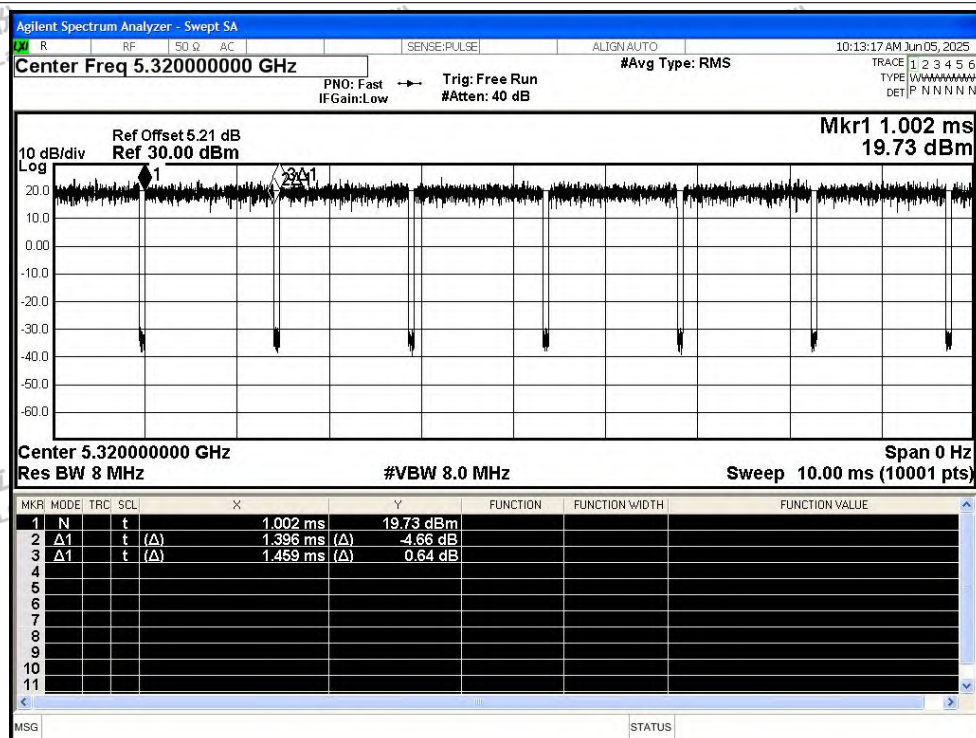

Duty Cycle NVNT n20 5260MHz Ant2

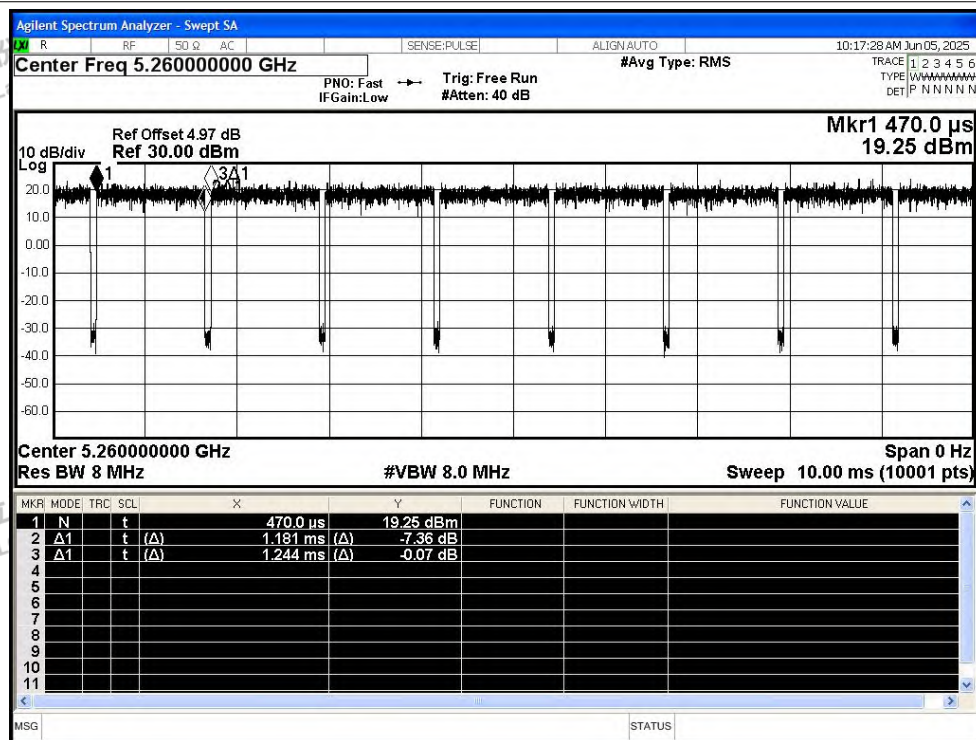

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant2

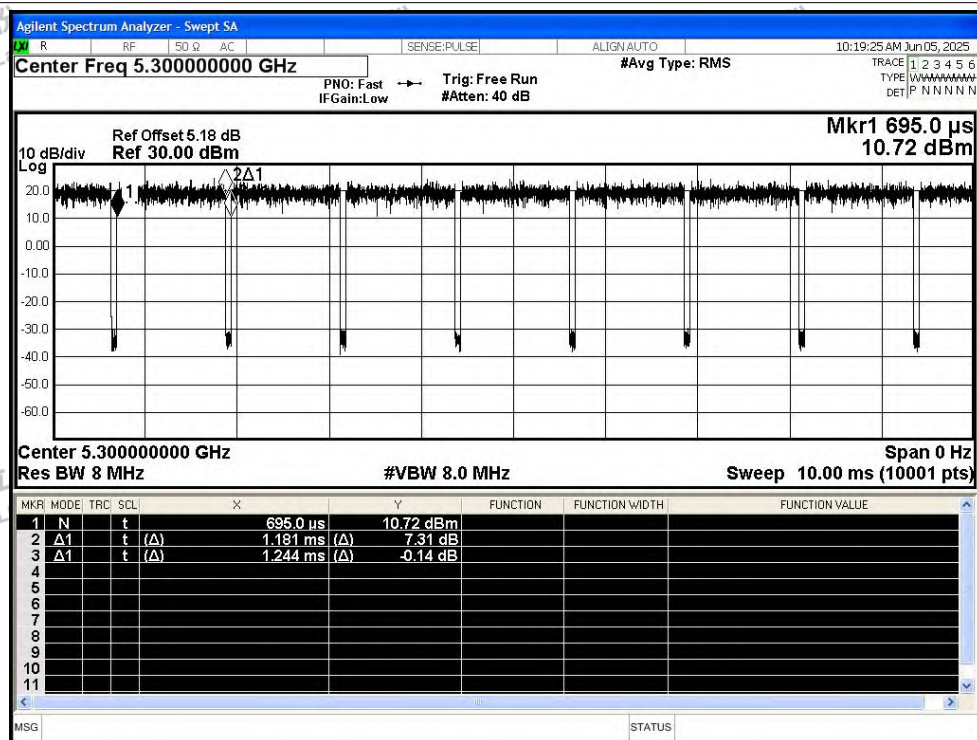

Duty Cycle NVNT n20 5320MHz Ant2

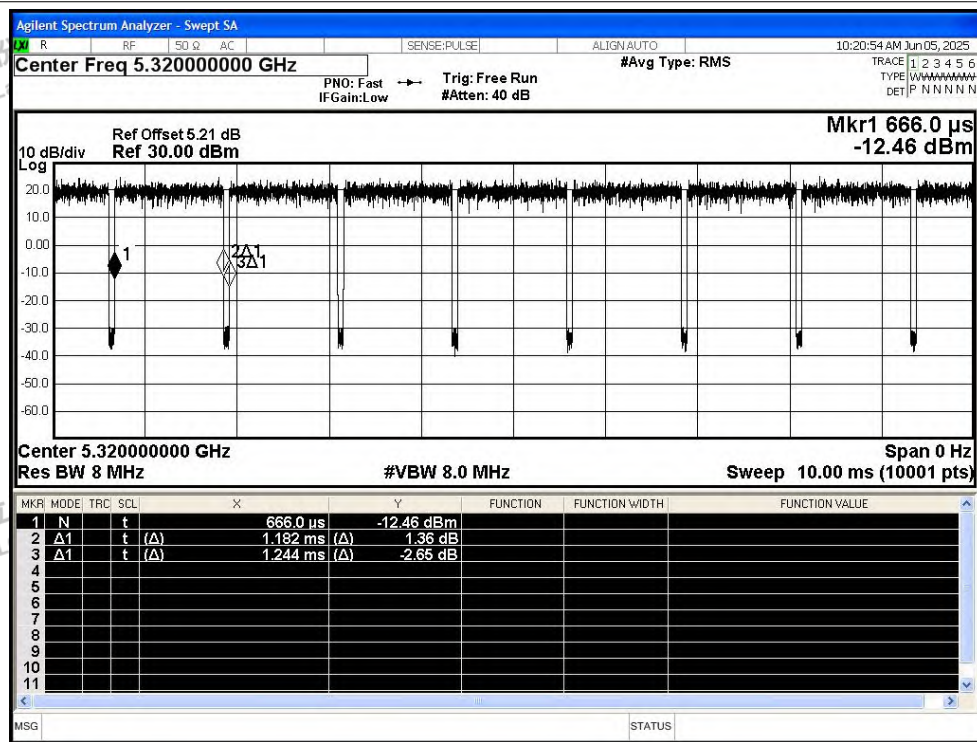

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant2

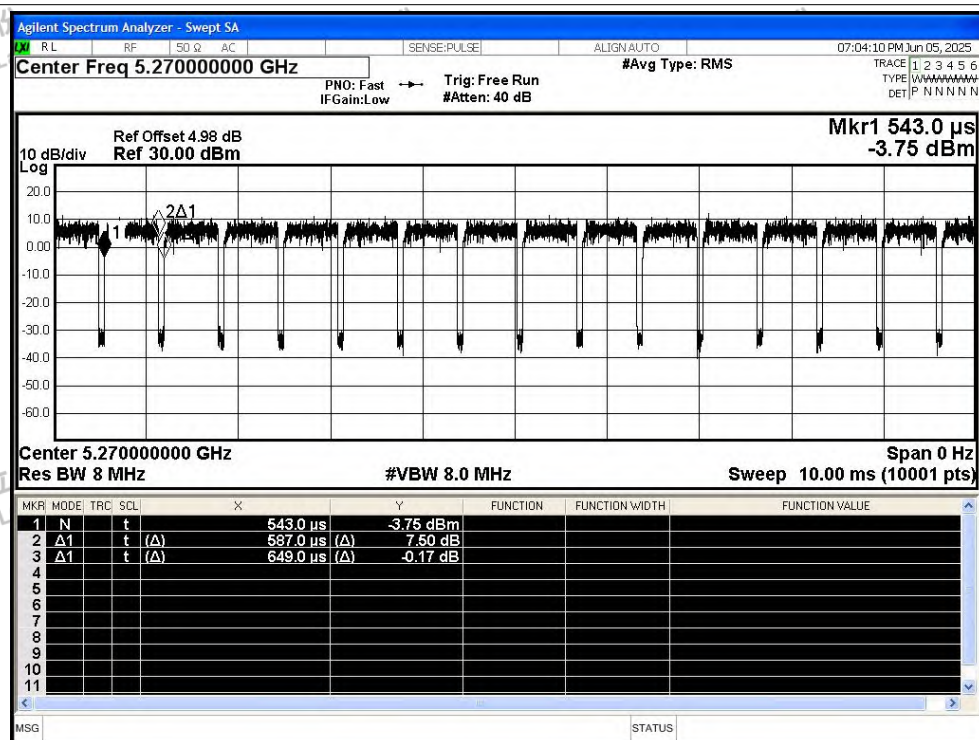

Duty Cycle NVNT n40 5310MHz Ant2

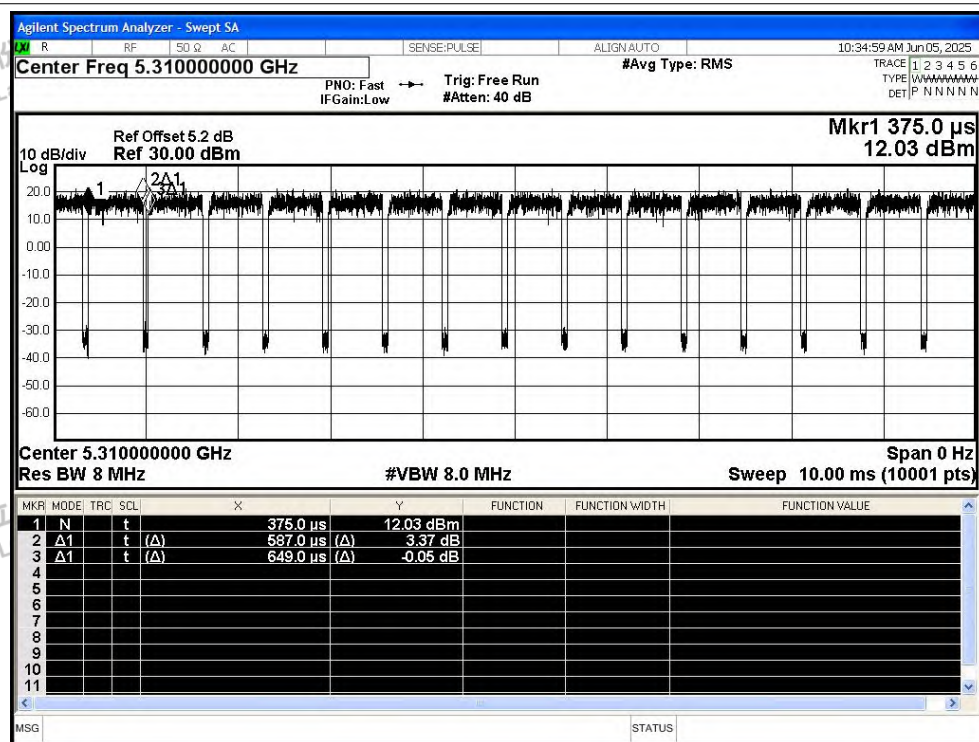

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity