




NVNT	ax20	5240	Ant4	5350	-50.51	5.19	-	49.91	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5350	-57.03	5.19	0.28	43.67	Average	54	Pass
NVNT	ax20	5240	Ant4	5384.64	-46.24	5.19	-	54.18	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5387.76	-56.31	5.19	0.28	44.39	Average	54	Pass
NVNT	ax20	5240	Ant4	5460	-49.16	5.19	-	51.26	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5460	-57.66	5.19	0.28	43.04	Average	54	Pass
NVNT	ax40	5190	Ant4	4500	-48.57	5.19	-	51.85	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	4500	-57.19	5.19	0.12	43.35	Average	54	Pass
NVNT	ax40	5190	Ant4	5149.7	-39.12	5.19	-	61.30	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5149.7	-53.7	5.19	0.12	46.84	Average	54	Pass
NVNT	ax40	5190	Ant4	5150	-39.12	5.19	-	61.30	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5150	-53.7	5.19	0.12	46.84	Average	54	Pass
NVNT	ax40	5230	Ant4	5350	-50.19	5.19	-	50.23	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5350	-57.25	5.19	0.12	43.29	Average	54	Pass
NVNT	ax40	5230	Ant4	5433	-46.65	5.19	-	53.77	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5406	-56.31	5.19	0.12	44.23	Average	54	Pass
NVNT	ax40	5230	Ant4	5460	-48.98	5.19	-	51.44	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5460	-56.81	5.19	0.12	43.73	Average	54	Pass
NVNT	ax80	5210	Ant4	5350	-48.84	5.19	-	51.58	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5350	-56.35	5.19	0.25	44.32	Average	54	Pass
NVNT	ax80	5210	Ant4	5446.8	-46.17	5.19	-	54.25	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5351.76	-55.69	5.19	0.25	44.98	Average	54	Pass
NVNT	ax80	5210	Ant4	5460	-49.25	5.19	-	51.17	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5460	-56.73	5.19	0.25	43.94	Average	54	Pass
NVNT	ax80	5210	Ant4	4500	-48.82	5.19	-	51.60	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	4500	-57.46	5.19	0.25	43.21	Average	54	Pass
NVNT	ax80	5210	Ant4	5148.59	-41.84	5.19	-	58.58	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5147.8	-53.08	5.19	0.25	47.59	Average	54	Pass
NVNT	ax80	5210	Ant4	5150	-44.2	5.19	-	56.22	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5150	-53.79	5.19	0.25	46.88	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant4 Peak

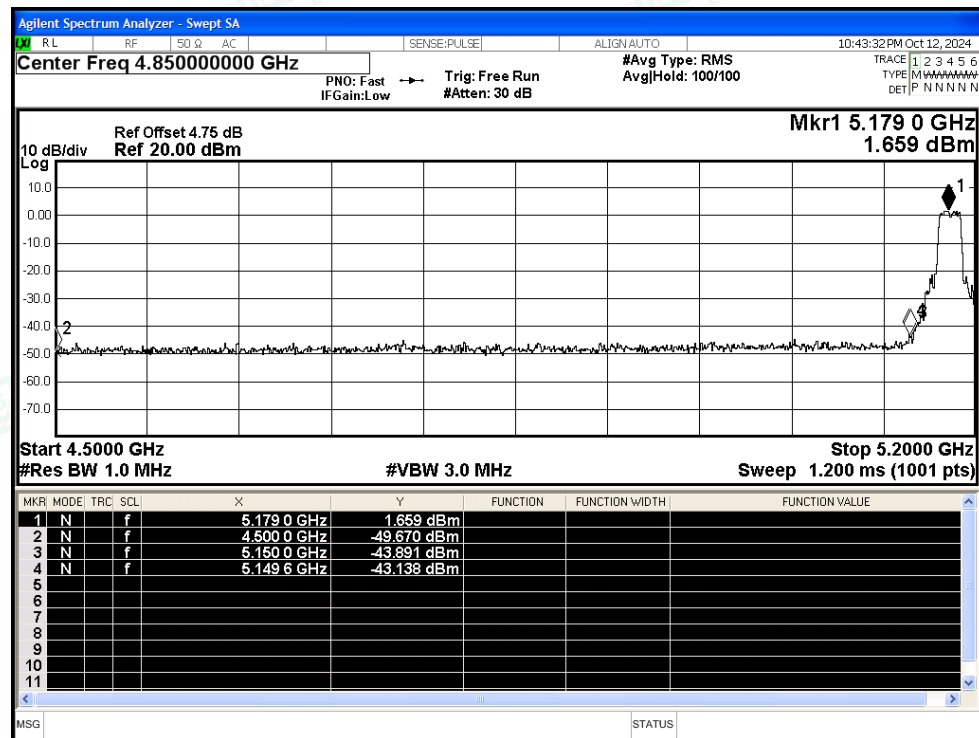


Restrict Band NVNT a 5180MHz Ant4 Average

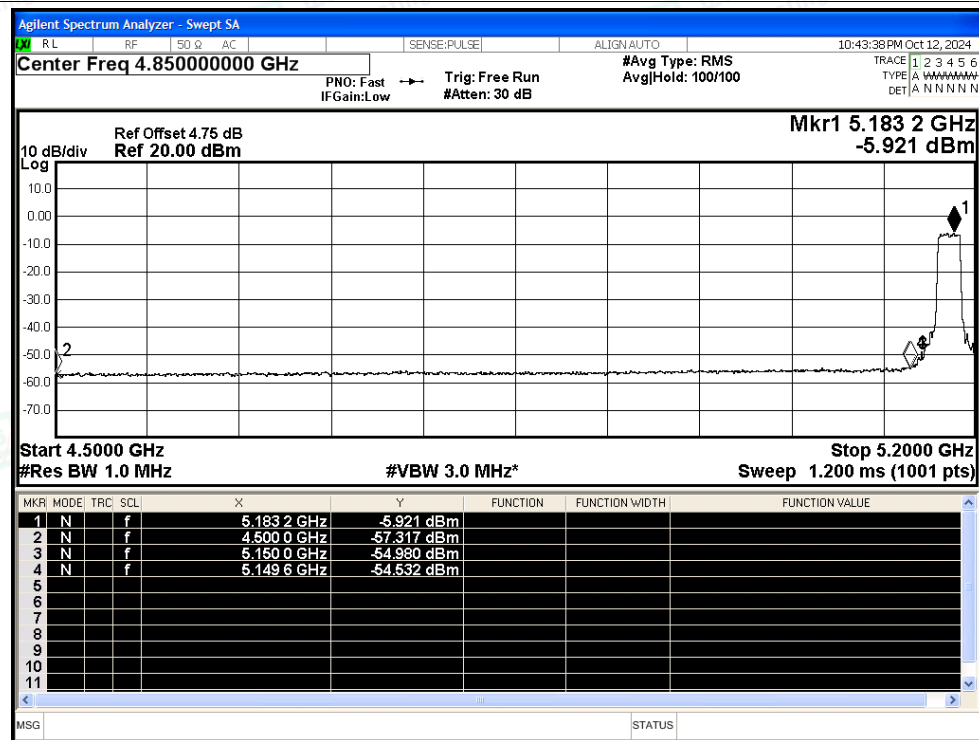




Restrict Band NVNT a 5240MHz Ant4 Peak

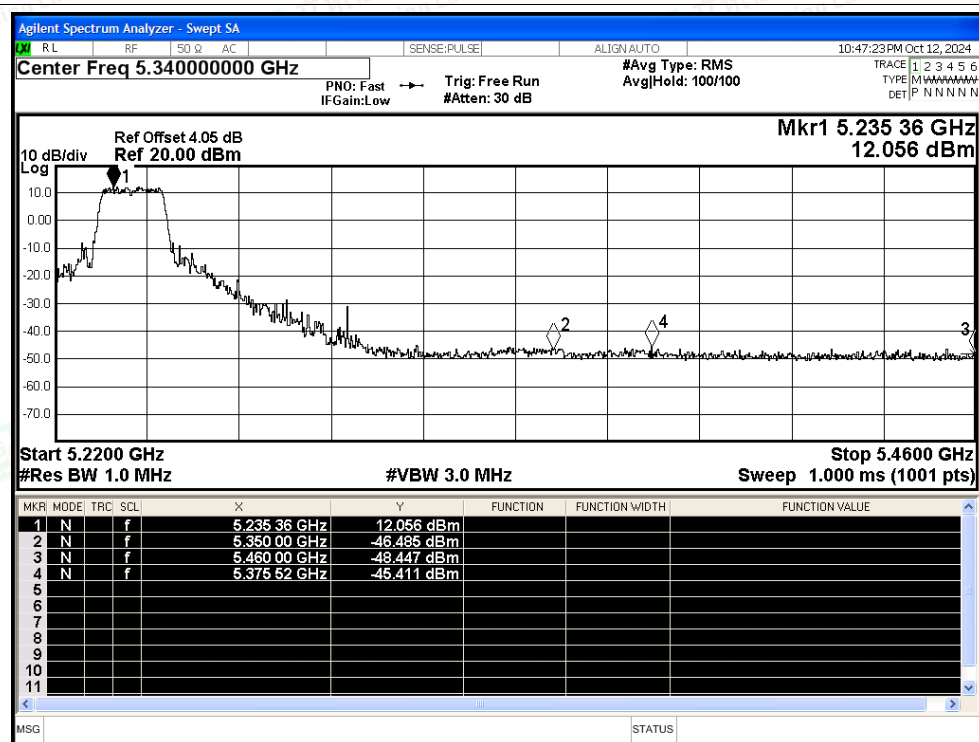


Restrict Band NVNT a 5240MHz Ant4 Average

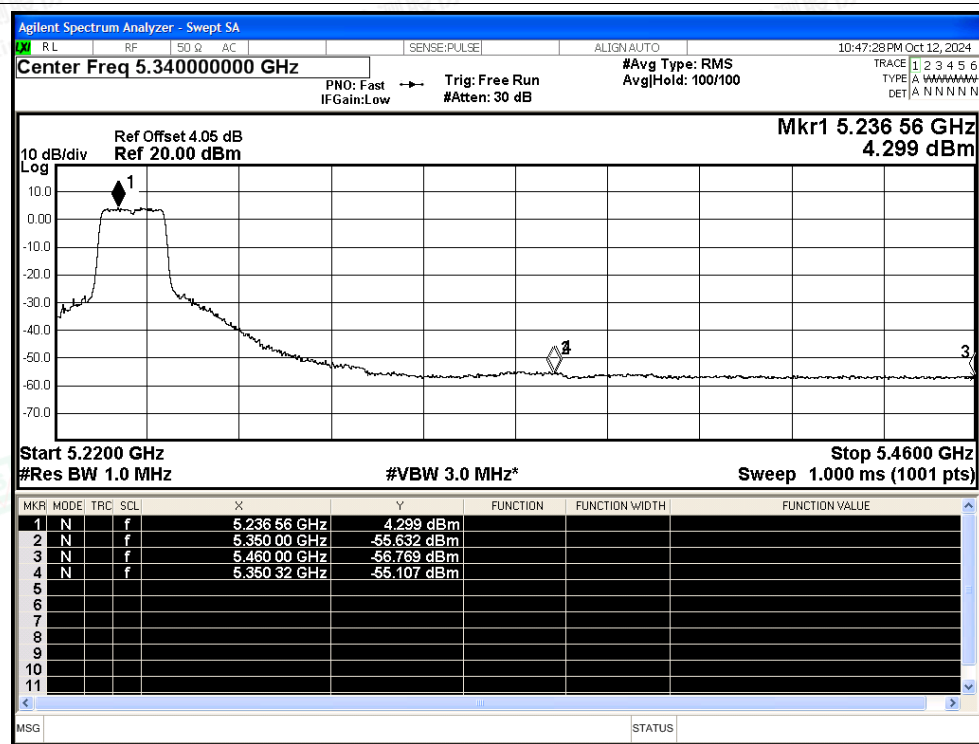




Restrict Band NVNT n20 5180MHz Ant4 Peak

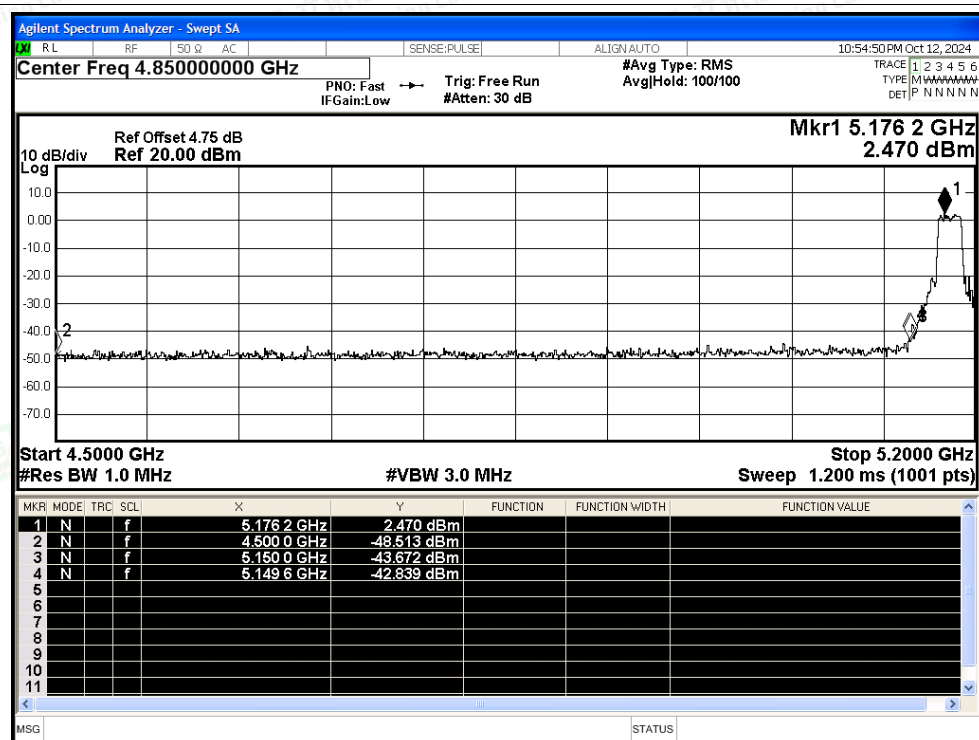


Restrict Band NVNT n20 5180MHz Ant4 Average

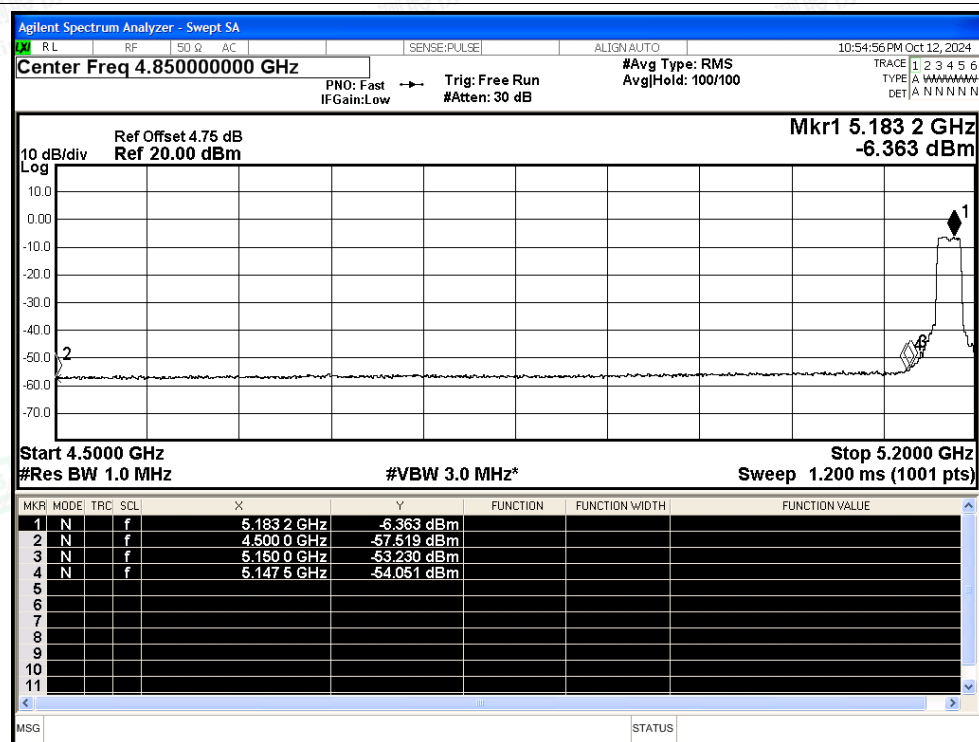




Restrict Band NVNT n20 5240MHz Ant4 Peak

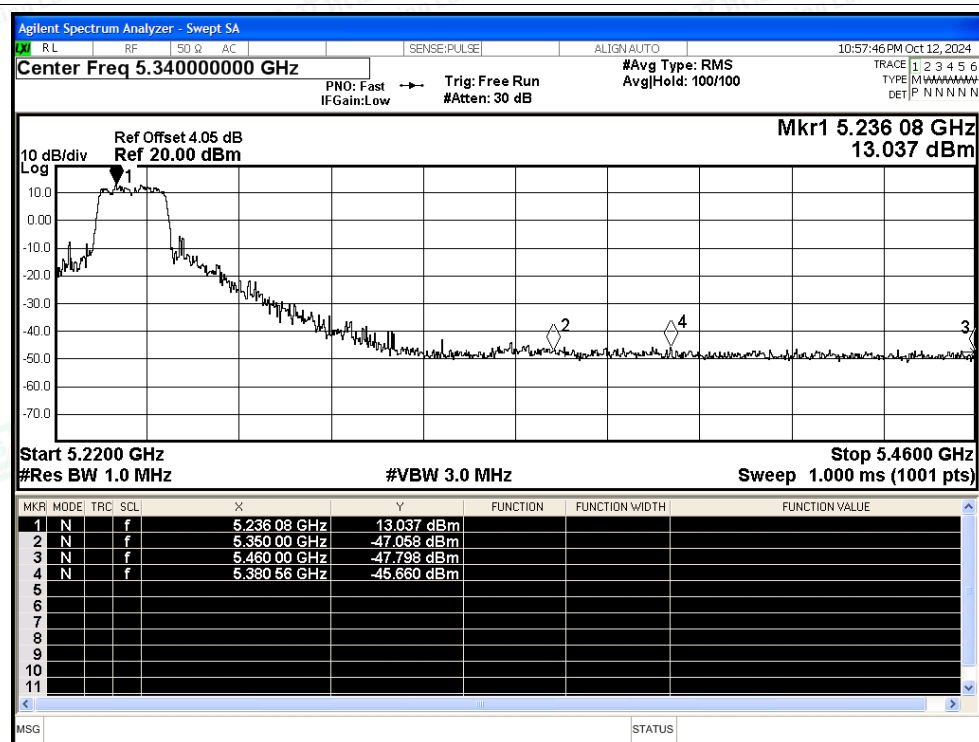

Restrict Band NVNT n20 5240MHz Ant4 Average

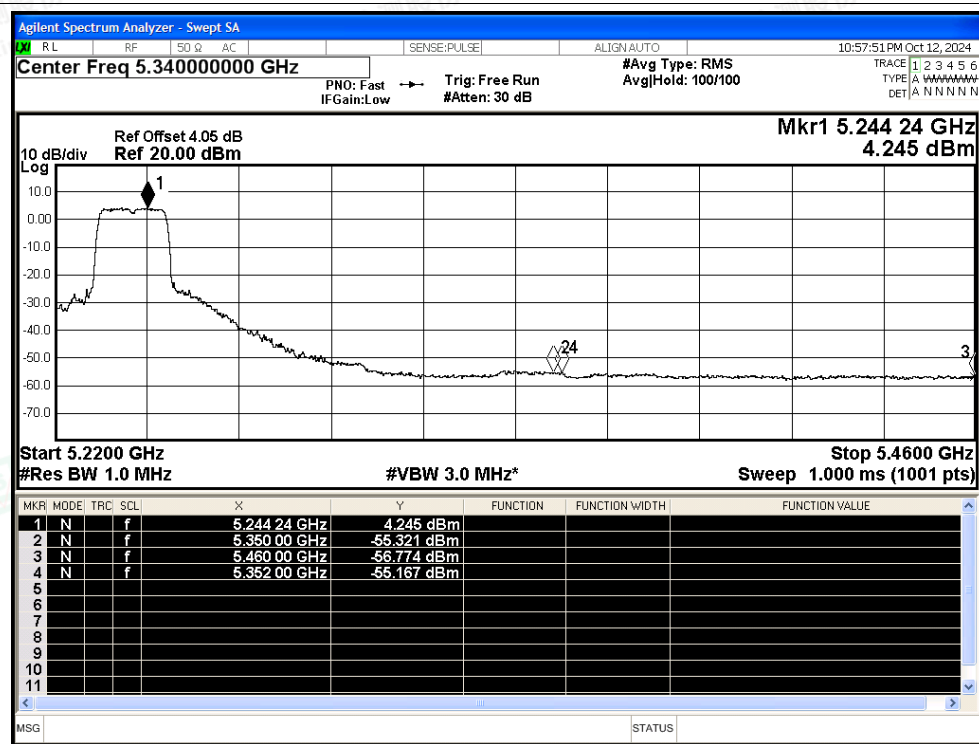

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant4 Peak

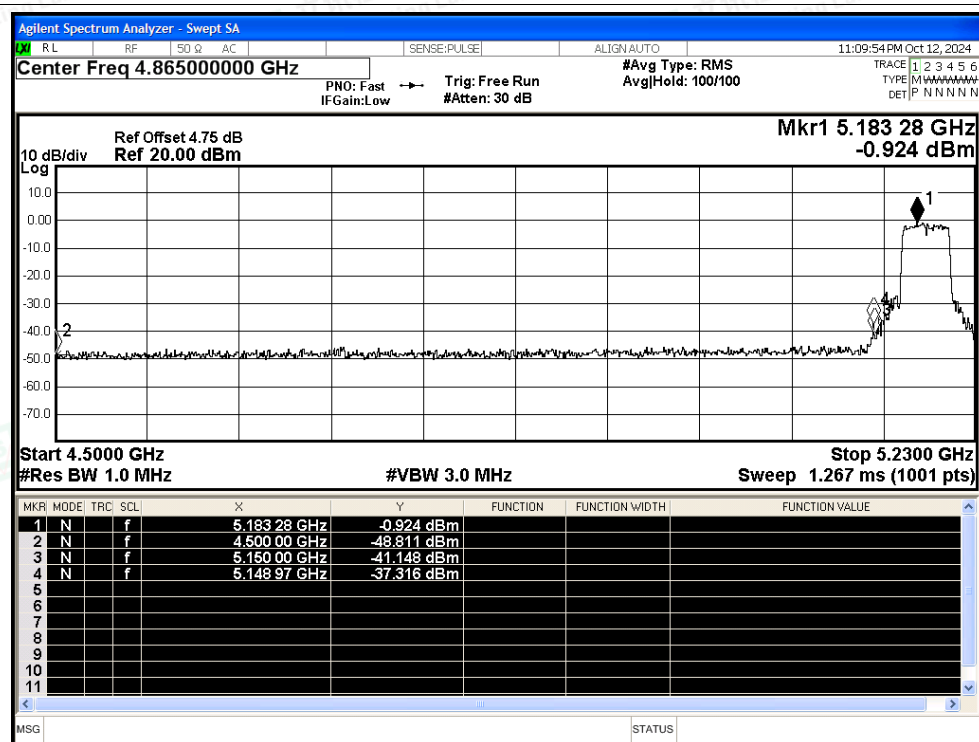


Restrict Band NVNT n40 5190MHz Ant4 Average

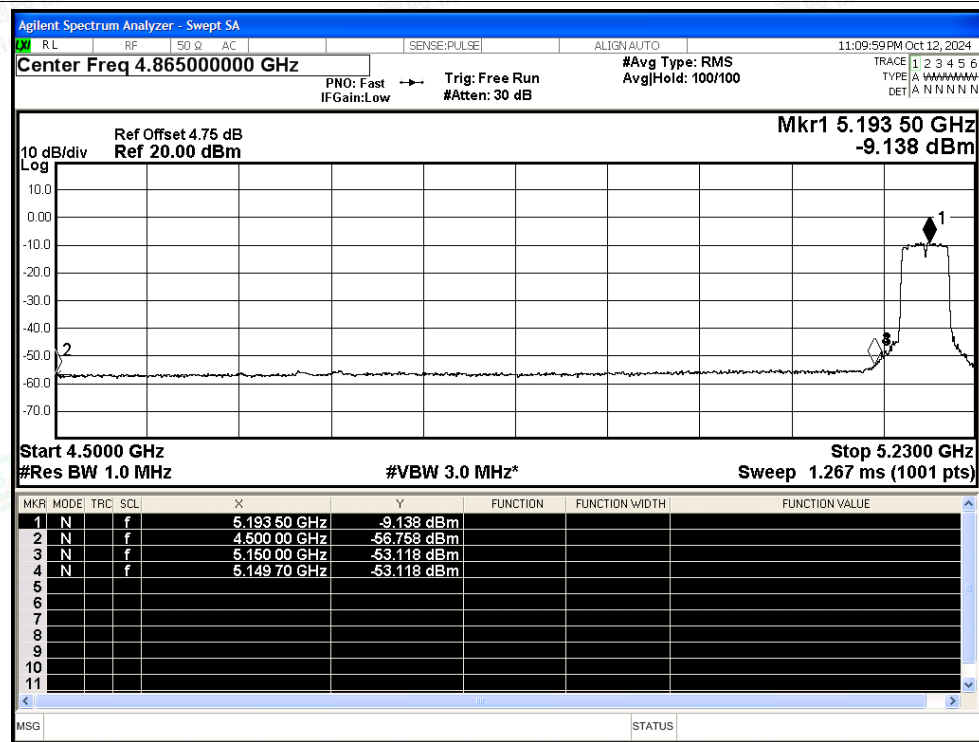




Restrict Band NVNT n40 5230MHz Ant4 Peak

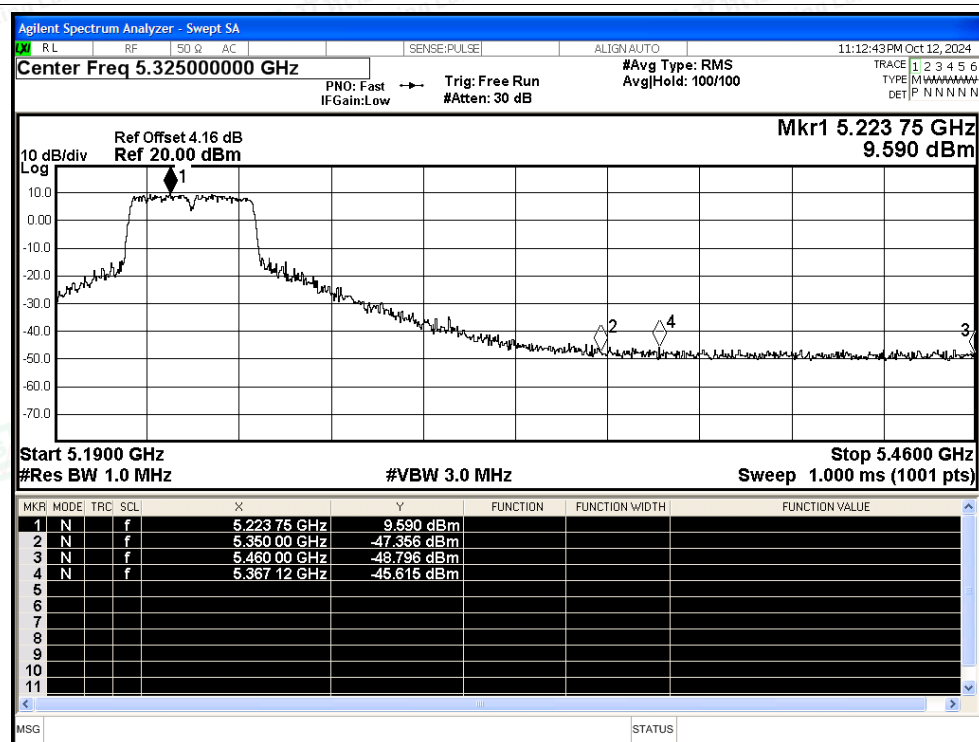


Restrict Band NVNT n40 5230MHz Ant4 Average

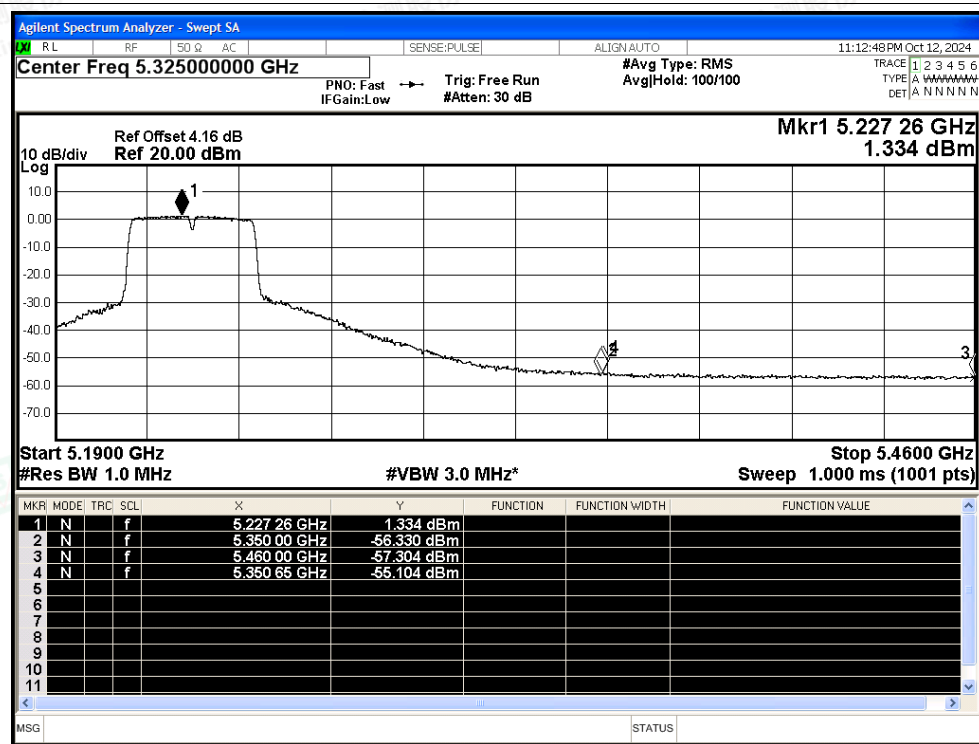




Restrict Band NVNT ac20 5180MHz Ant4 Peak

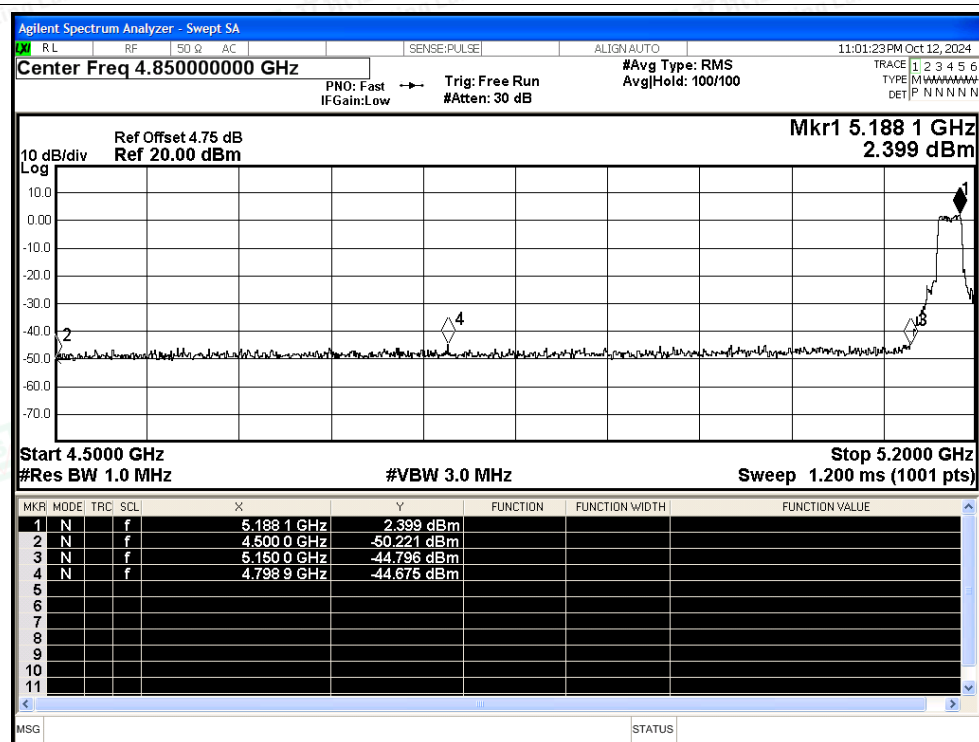


Restrict Band NVNT ac20 5180MHz Ant4 Average

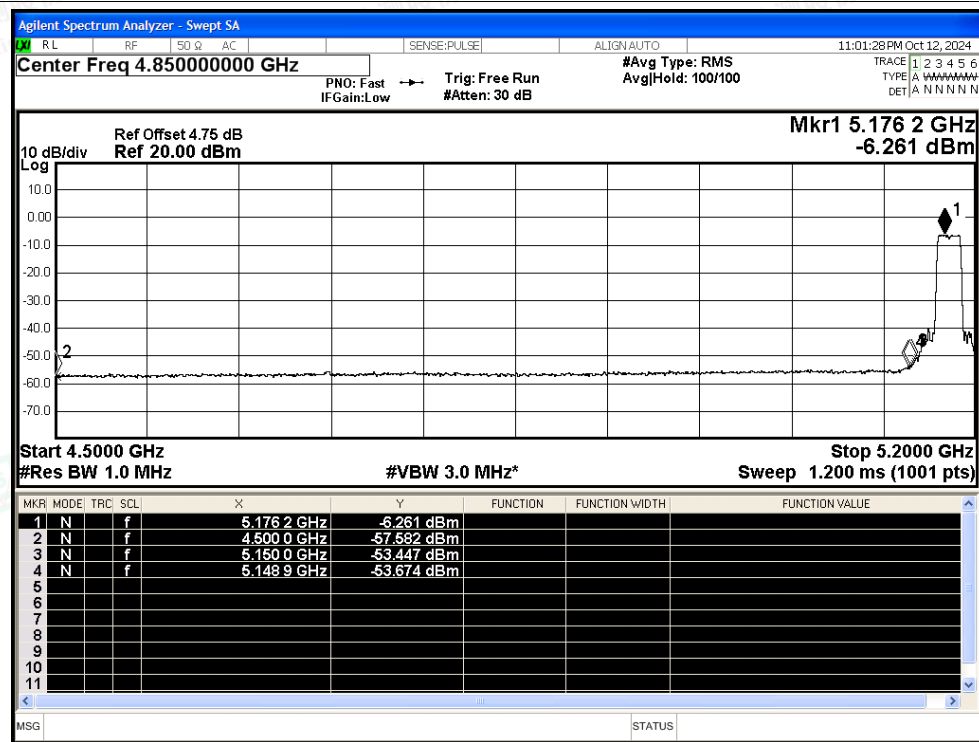




Restrict Band NVNT ac20 5240MHz Ant4 Peak

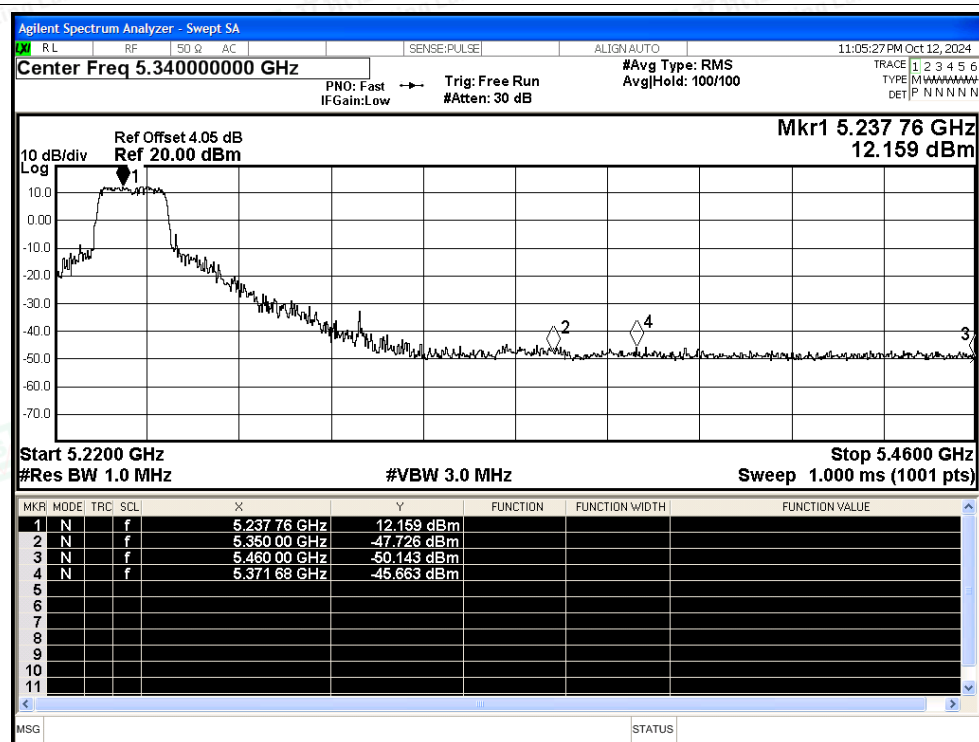


Restrict Band NVNT ac20 5240MHz Ant4 Average

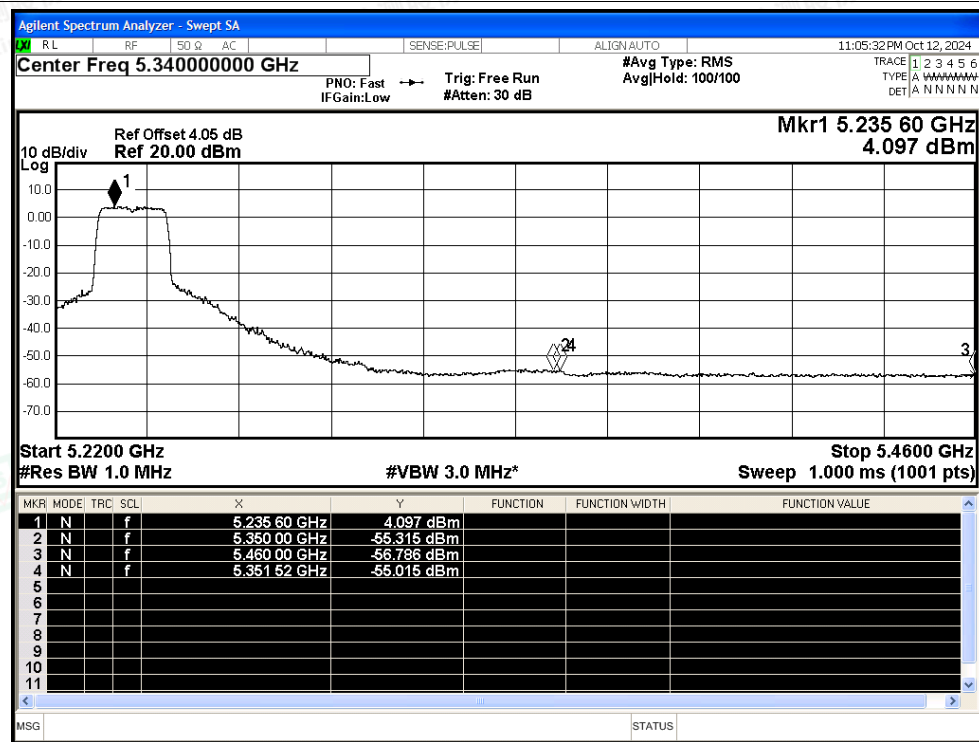




Restrict Band NVNT ac40 5190MHz Ant4 Peak

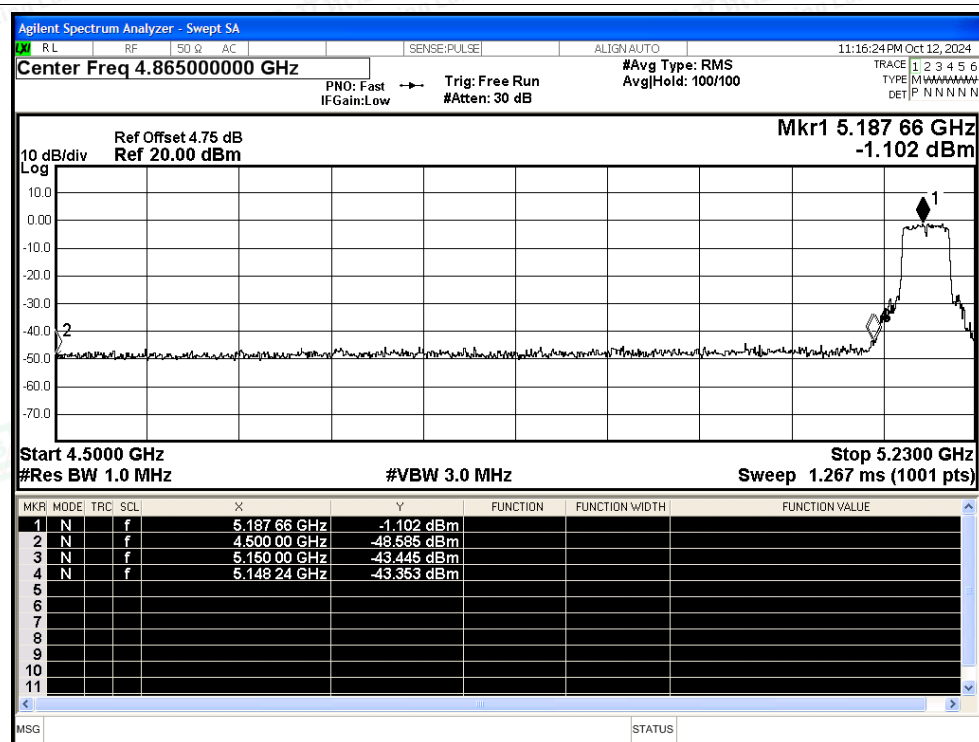


Restrict Band NVNT ac40 5190MHz Ant4 Average

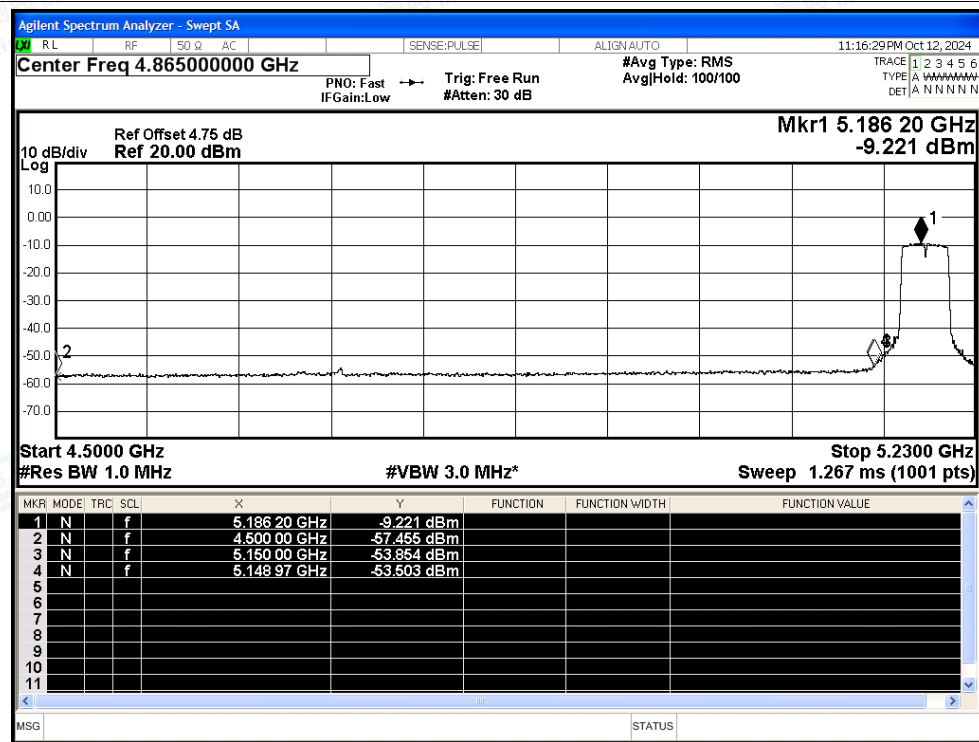




Restrict Band NVNT ac40 5230MHz Ant4 Peak

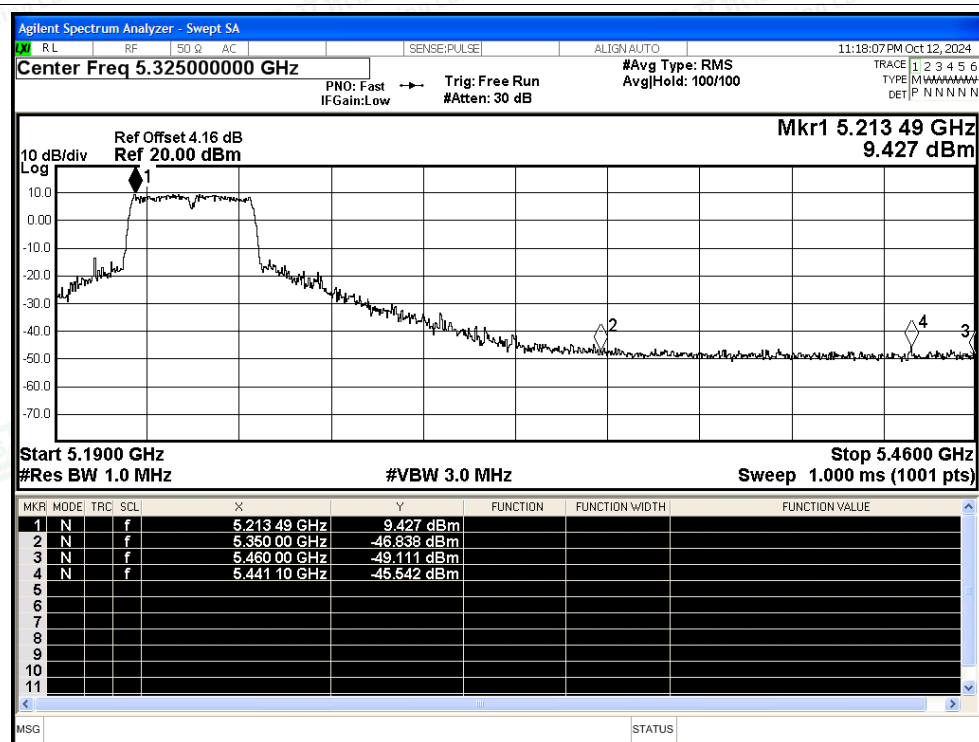

Restrict Band NVNT ac40 5230MHz Ant4 Average

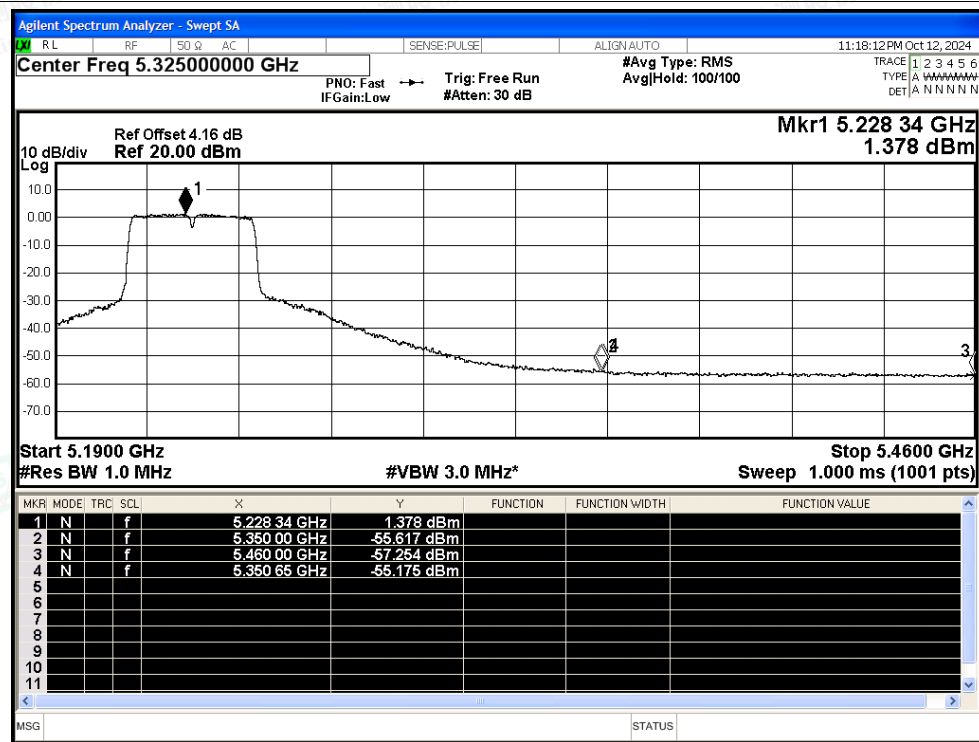

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant4 Peak

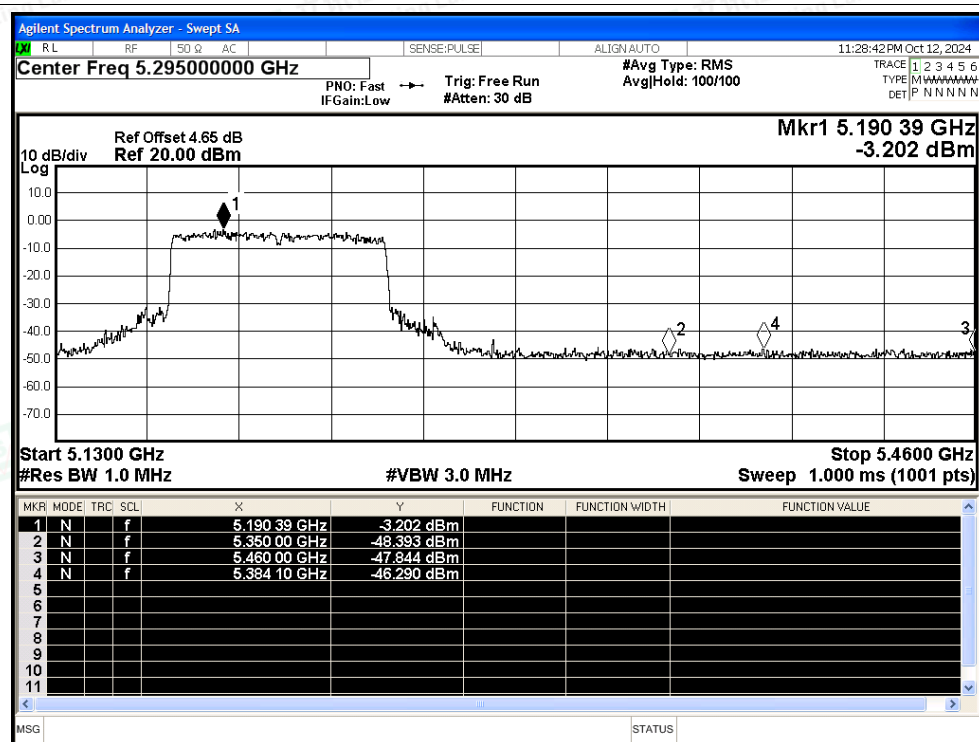


Restrict Band NVNT ac80 5210MHz Ant4 Average

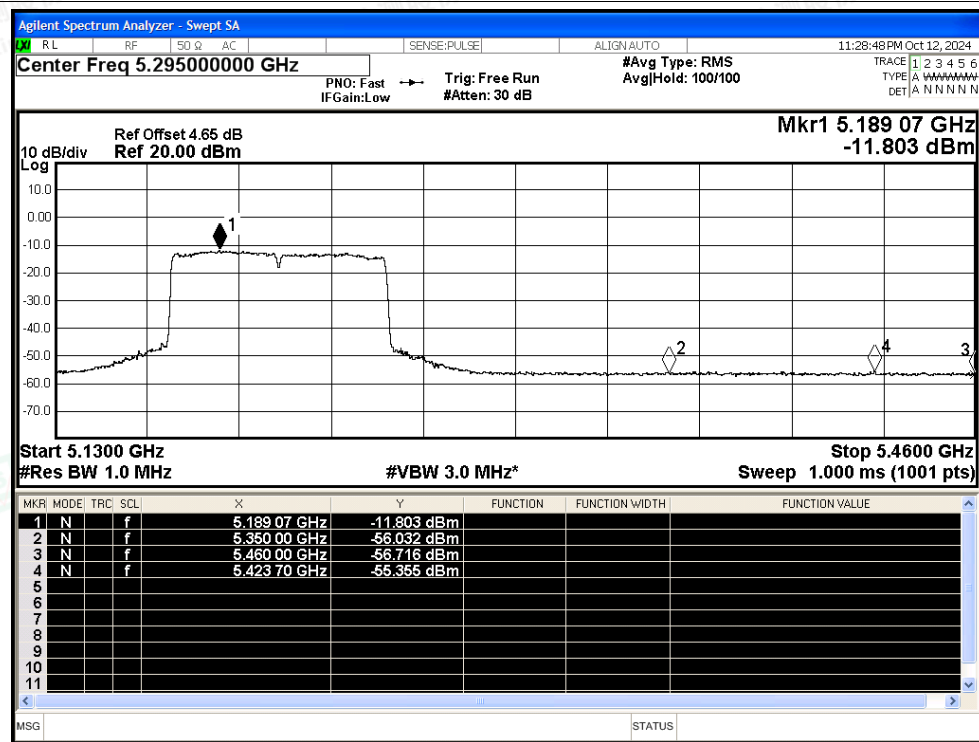




Restrict Band NVNT ac80 5210MHz Ant4 Peak

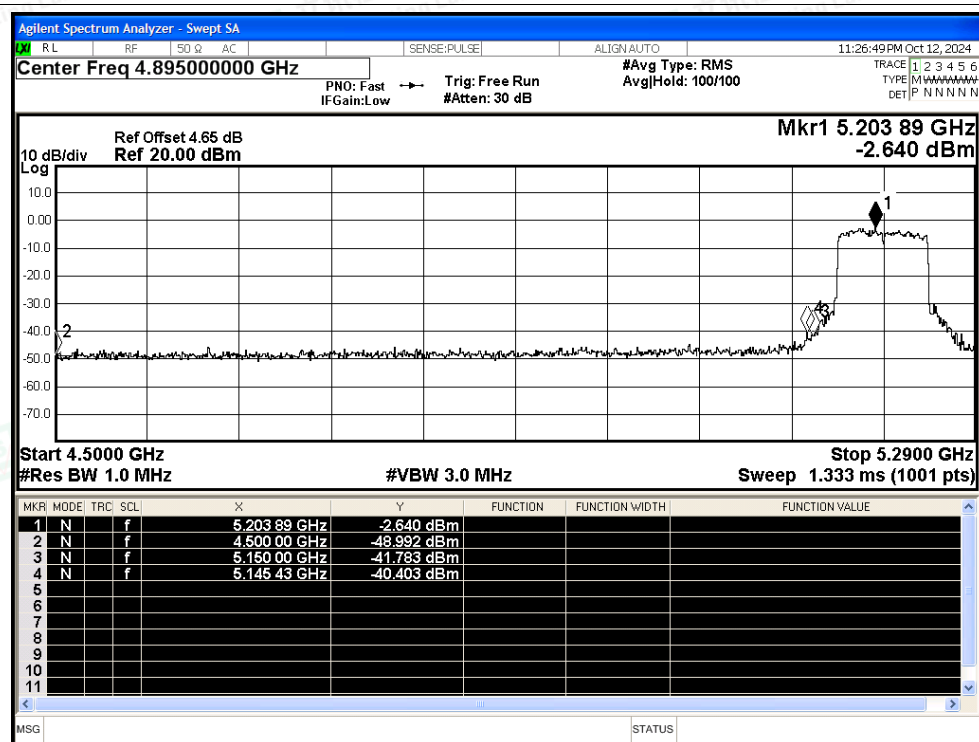


Restrict Band NVNT ac80 5210MHz Ant4 Average

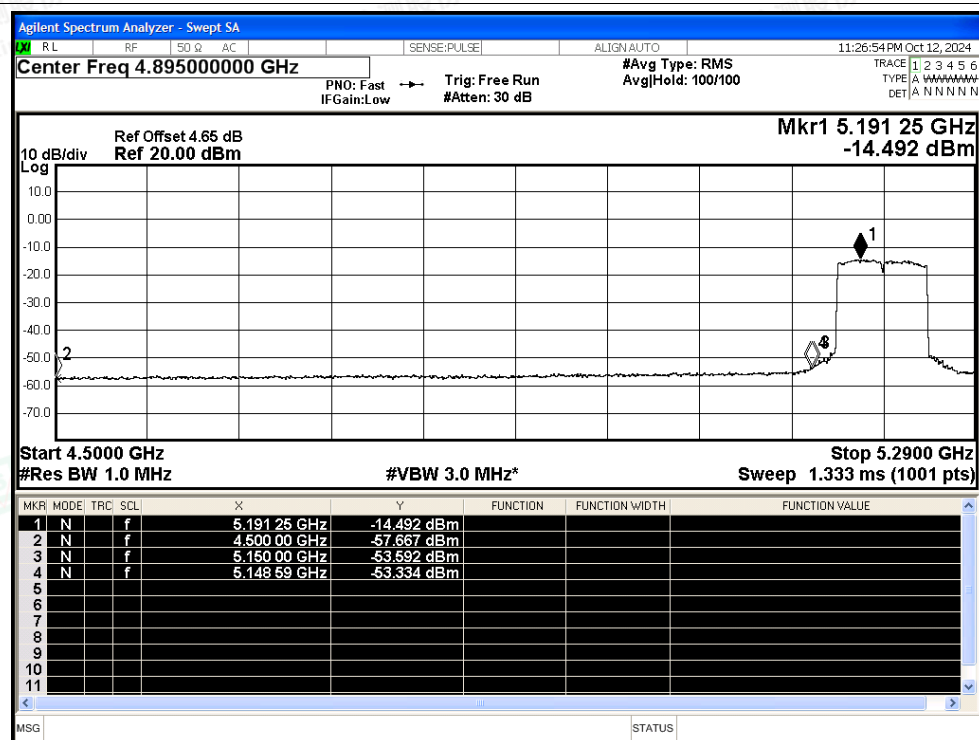


Restrict Band NVNT ax20 5180MHz Ant4 Peak



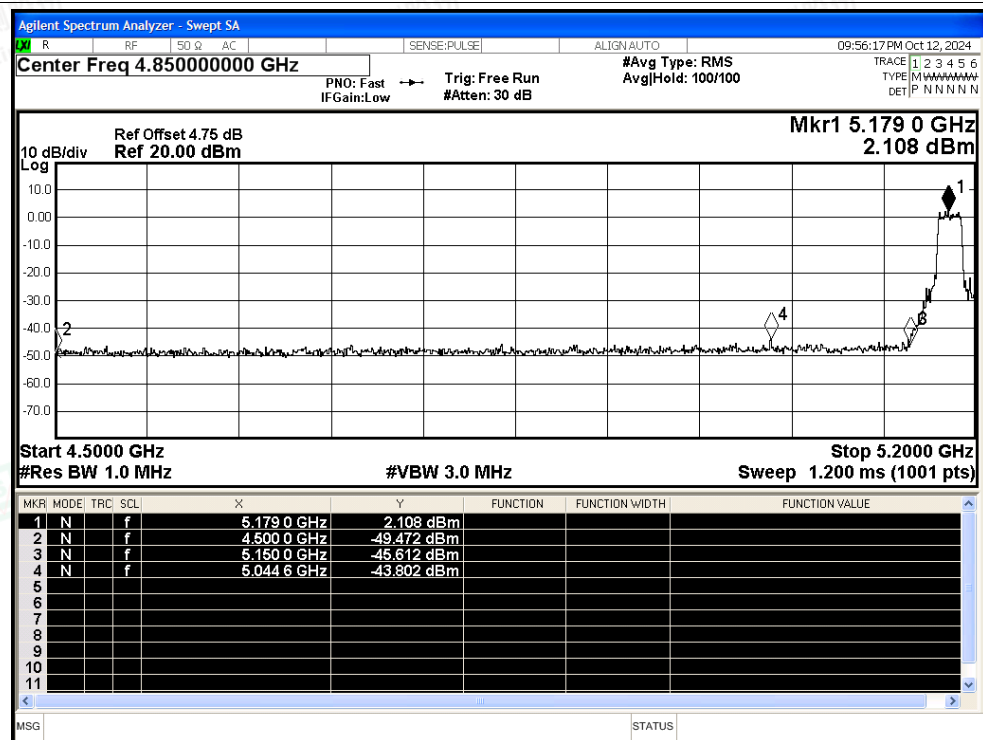


Restrict Band NVNT ax20 5180MHz Ant4 Average

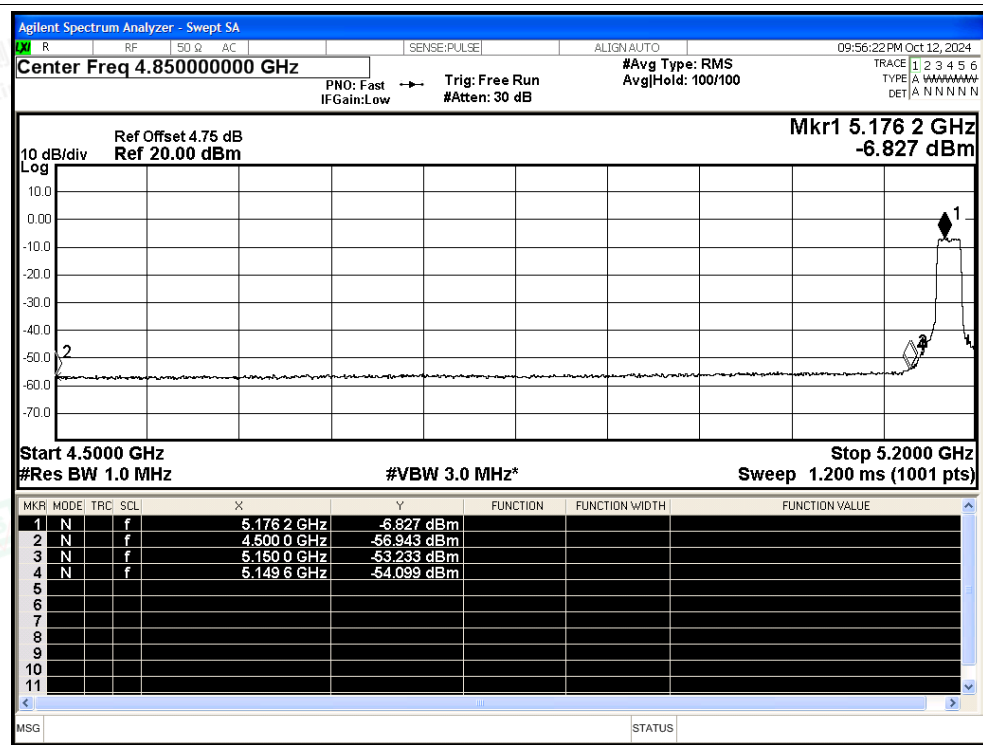




Restrict Band NVNT ax20 5240MHz Ant4 Peak

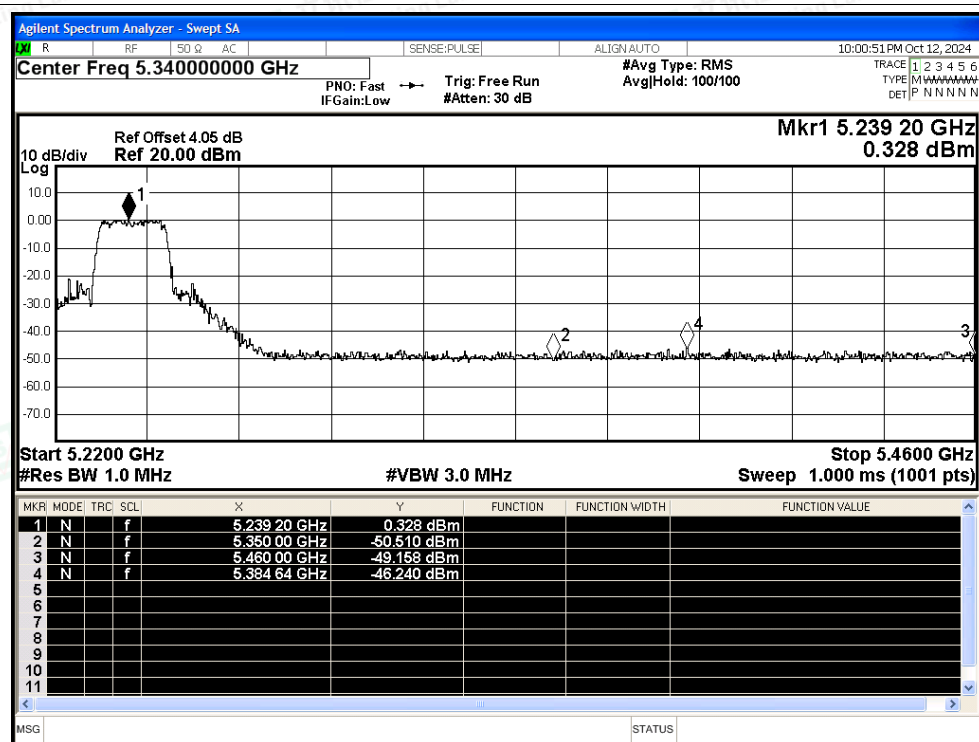


Restrict Band NVNT ax20 5240MHz Ant4 Average

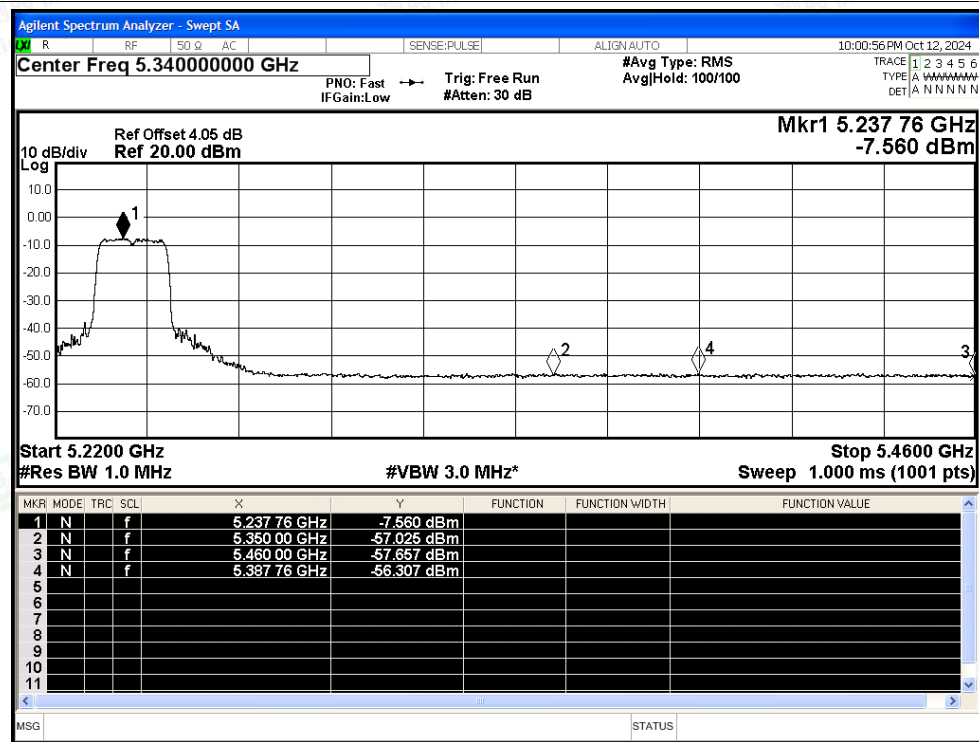




Restrict Band NVNT ax40 5190MHz Ant4 Peak

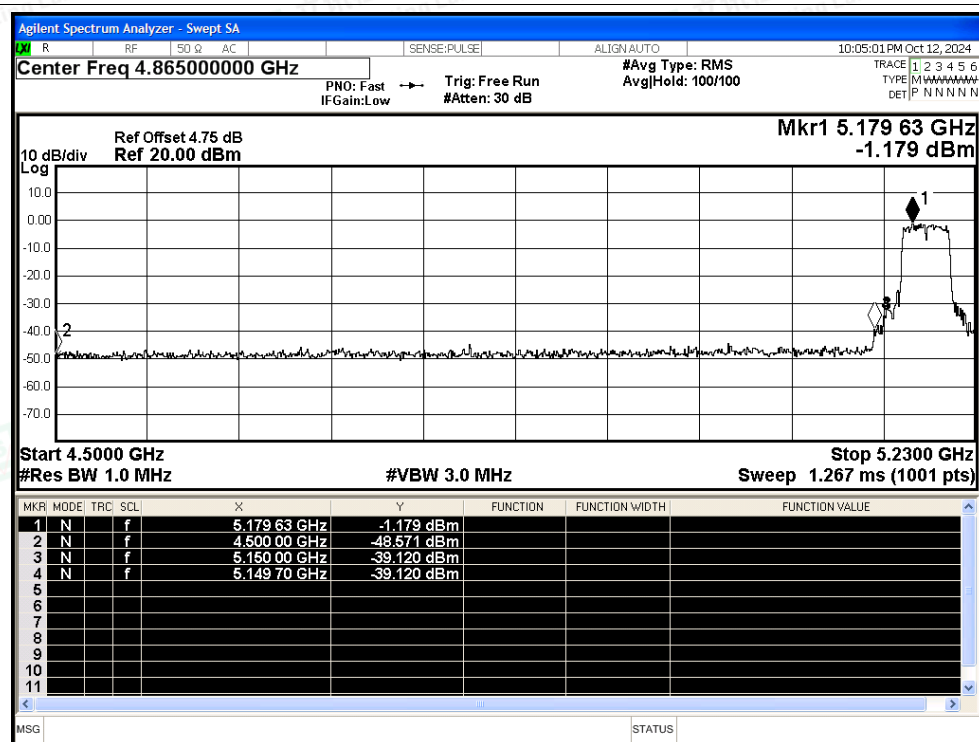


Restrict Band NVNT ax40 5190MHz Ant4 Average

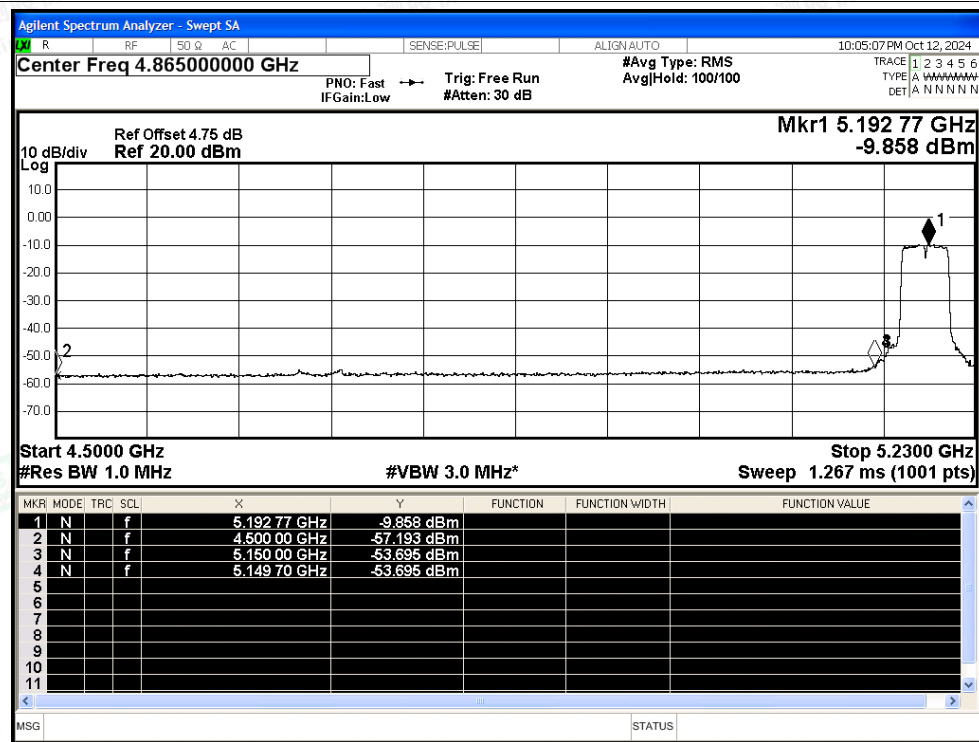




Restrict Band NVNT ax40 5230MHz Ant4 Peak

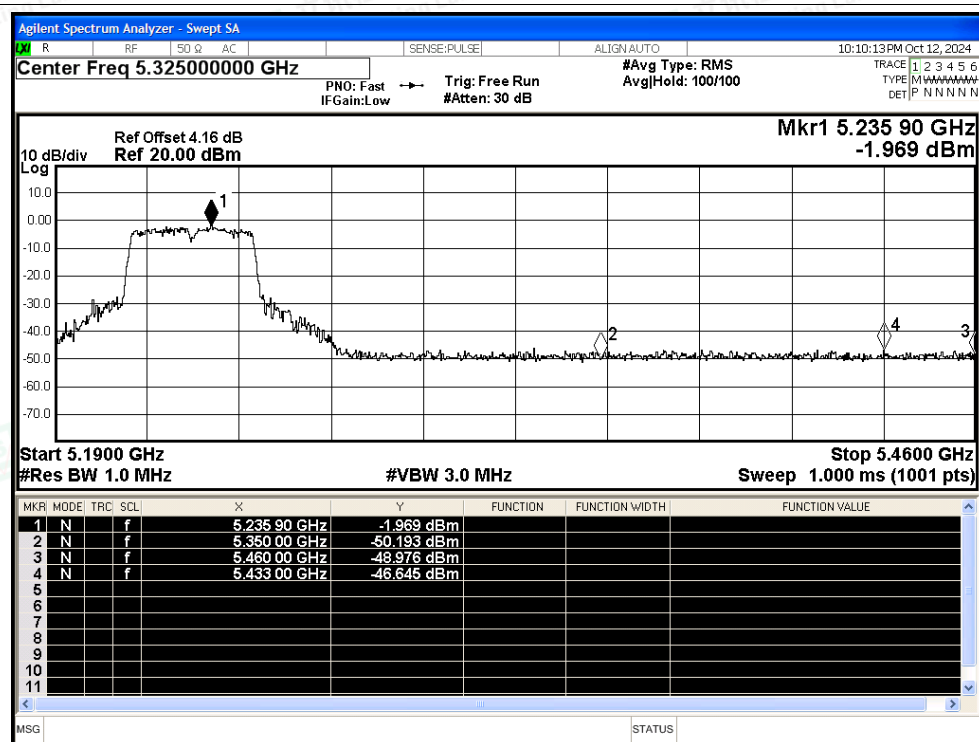


Restrict Band NVNT ax40 5230MHz Ant4 Average

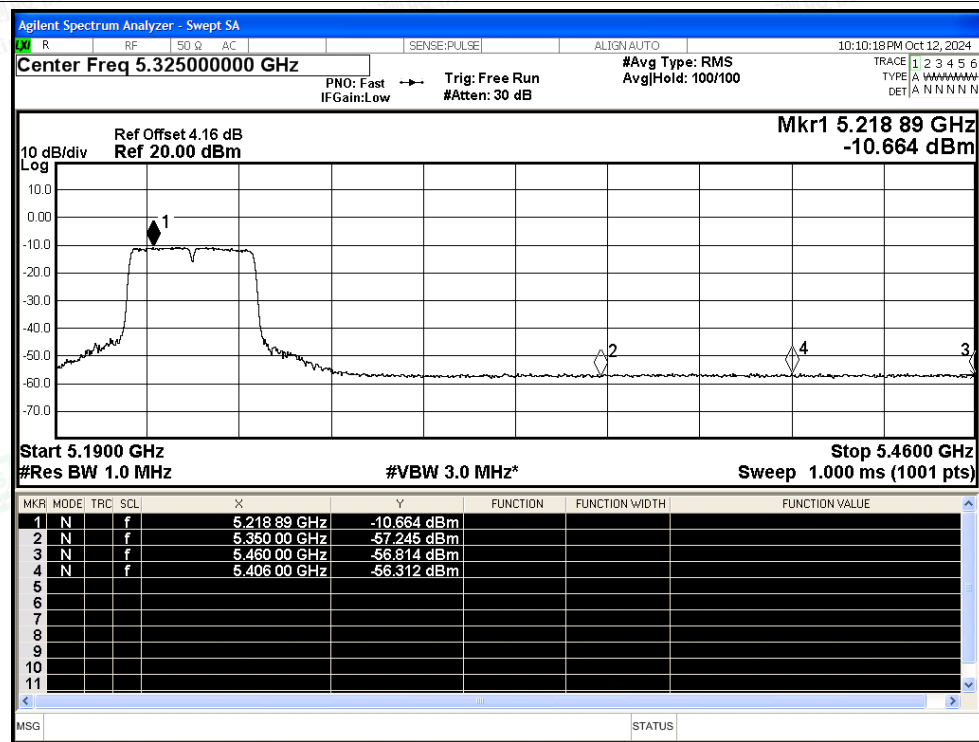




Restrict Band NVNT ax80 5210MHz Ant4 Peak

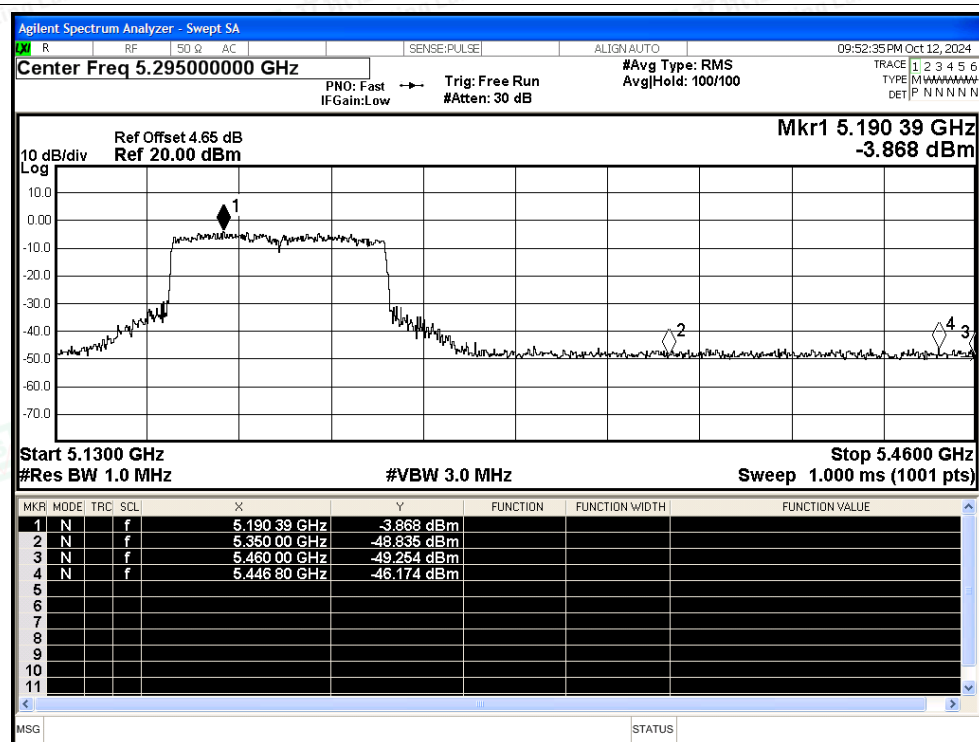


Restrict Band NVNT ax80 5210MHz Ant4 Average

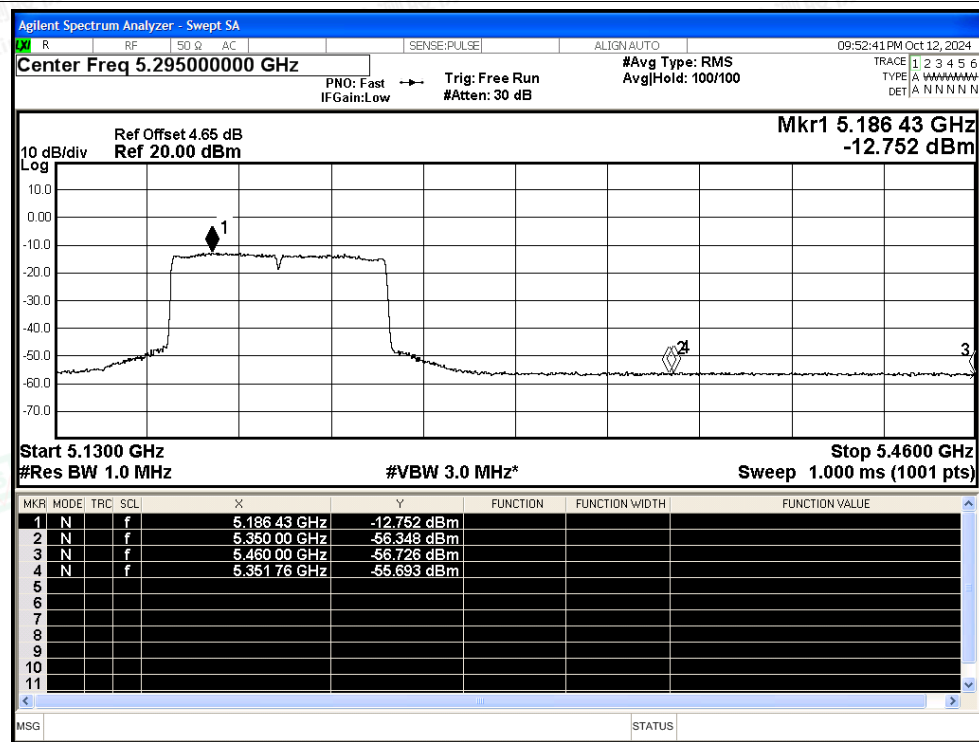




Restrict Band NVNT ax80 5210MHz Ant4 Peak

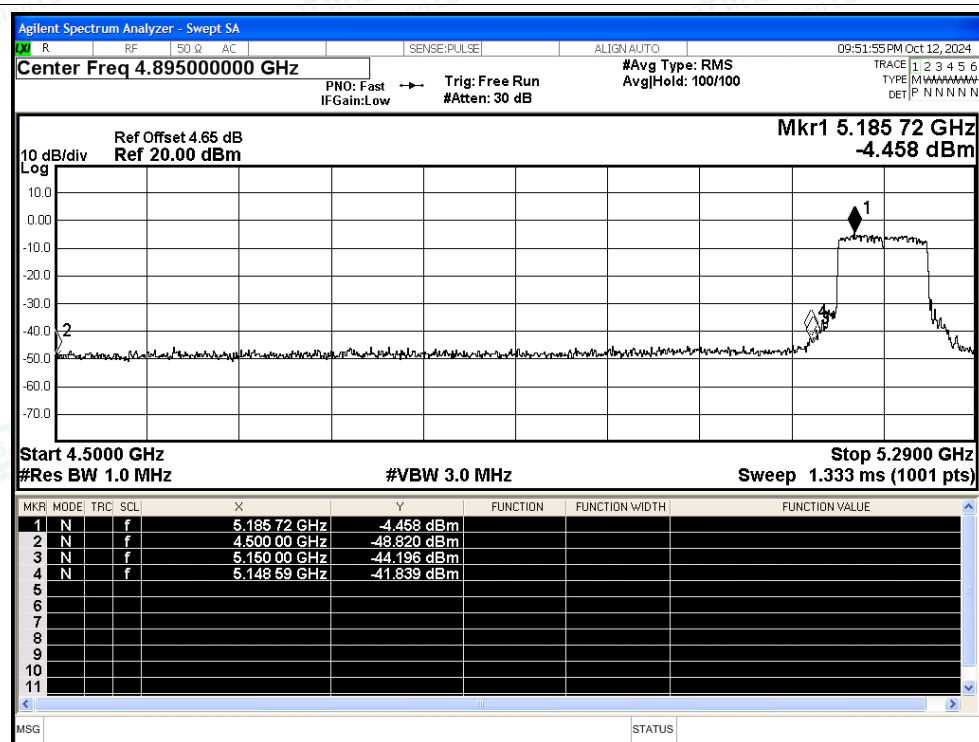

Restrict Band NVNT ax80 5210MHz Ant4 Average

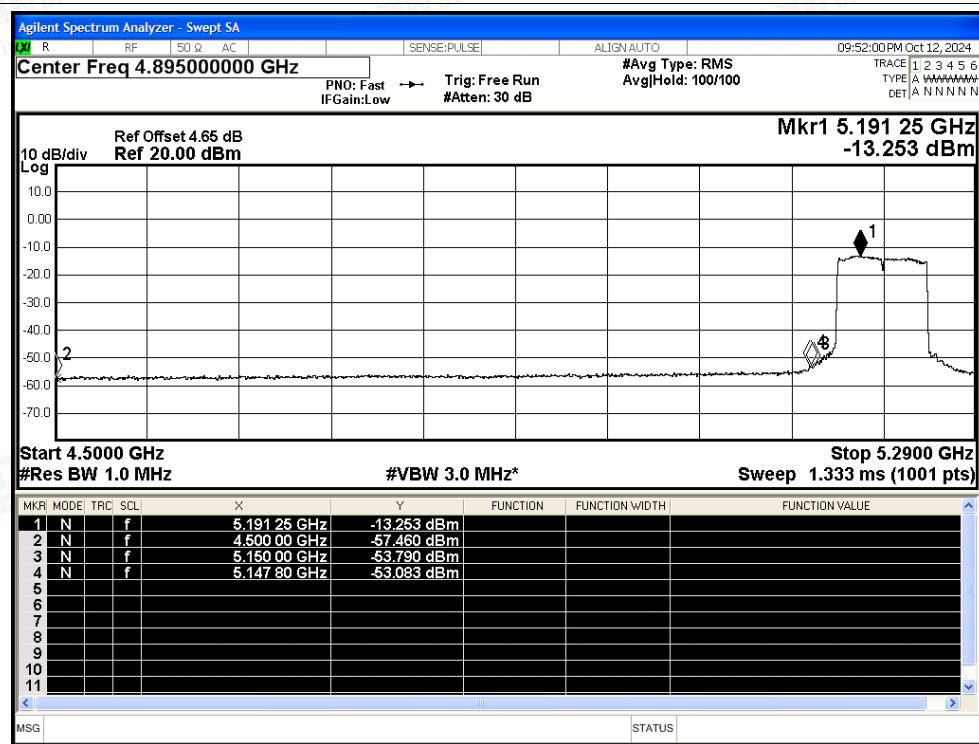



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant3 Power (dBm)	Ant4 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-49.25	-48.51	8.23	57.63	Peak	68.2	Pass
NVNT	n20	5180	4500	-57.11	-57.52	8.23	49.19	Average	54	Pass
NVNT	n20	5180	5149.6	-41.43	-42.84	8.23	64.42	Peak	68.2	Pass
NVNT	n20	5180	5148.9	-54.03	-54.05	8.23	52.46	Average	54	Pass
NVNT	n20	5180	5150	-41.44	-43.67	8.23	64.08	Peak	68.2	Pass
NVNT	n20	5180	5150	-53.71	-53.23	8.23	53.03	Average	54	Pass
NVNT	n20	5240	5350	-49.55	-47.06	8.23	58.37	Peak	68.2	Pass
NVNT	n20	5240	5350	-57.31	-55.32	8.23	50.30	Average	54	Pass
NVNT	n20	5240	5438.4	-45.33	-45.66	8.23	61.01	Peak	68.2	Pass
NVNT	n20	5240	5371.2	-56.09	-55.17	8.23	50.89	Average	54	Pass
NVNT	n20	5240	5460	-48.35	-47.8	8.23	58.43	Peak	68.2	Pass
NVNT	n20	5240	5460	-57.31	-56.77	8.23	49.47	Average	54	Pass
NVNT	n40	5190	4500	-49.82	-48.81	8.23	57.21	Peak	68.2	Pass
NVNT	n40	5190	4500	-57.4	-56.76	8.23	49.43	Average	54	Pass
NVNT	n40	5190	5149.7	-41.28	-37.32	8.23	67.63	Peak	68.2	Pass
NVNT	n40	5190	5149.7	-53.71	-53.12	8.23	53.09	Average	54	Pass
NVNT	n40	5190	5150	-41.28	-41.15	8.23	65.28	Peak	68.2	Pass
NVNT	n40	5190	5150	-53.71	-53.12	8.23	53.09	Average	54	Pass
NVNT	n40	5230	5350	-49.79	-47.36	8.23	58.09	Peak	68.2	Pass
NVNT	n40	5230	5350	-55.98	-56.33	8.23	50.35	Average	54	Pass
NVNT	n40	5230	5372.25	-45.76	-45.62	8.23	60.81	Peak	68.2	Pass
NVNT	n40	5230	5350.65	-55.41	-55.1	8.23	51.25	Average	54	Pass
NVNT	n40	5230	5460	-48.49	-48.8	8.23	57.86	Peak	68.2	Pass
NVNT	n40	5230	5460	-57.13	-57.3	8.23	49.28	Average	54	Pass
NVNT	ac20	5180	4500	-49.1	-50.22	8.23	56.87	Peak	68.2	Pass
NVNT	ac20	5180	4500	-57.32	-57.58	8.23	49.05	Average	54	Pass
NVNT	ac20	5180	5149.6	-43.82	-44.68	8.23	62.27	Peak	68.2	Pass
NVNT	ac20	5180	5148.9	-54.36	-53.67	8.23	52.50	Average	54	Pass
NVNT	ac20	5180	5150	-46	-44.8	8.23	61.14	Peak	68.2	Pass
NVNT	ac20	5180	5150	-53.98	-53.45	8.23	52.79	Average	54	Pass
NVNT	ac20	5240	5350	-48.88	-47.73	8.23	58.23	Peak	68.2	Pass
NVNT	ac20	5240	5350	-55.98	-55.32	8.23	50.86	Average	54	Pass
NVNT	ac20	5240	5435.52	-45.31	-45.66	8.23	61.02	Peak	68.2	Pass
NVNT	ac20	5240	5350.8	-55.06	-55.02	8.23	51.46	Average	54	Pass
NVNT	ac20	5240	5460	-49.16	-50.14	8.23	56.88	Peak	68.2	Pass
NVNT	ac20	5240	5460	-56.99	-56.79	8.23	49.61	Average	54	Pass
NVNT	ac40	5190	4500	-49	-48.59	8.23	57.71	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	-57.55	-57.46	8.23	48.99	Average	54	Pass
NVNT	ac40	5190	5148.24	-40.51	-43.35	8.23	64.80	Peak	68.2	Pass
NVNT	ac40	5190	5149.7	-53.66	-53.5	8.23	52.92	Average	54	Pass
NVNT	ac40	5190	5150	-43.41	-43.45	8.23	63.07	Peak	68.2	Pass
NVNT	ac40	5190	5150	-53.66	-53.85	8.23	52.74	Average	54	Pass
NVNT	ac40	5230	5350	-46.52	-46.84	8.23	59.82	Peak	68.2	Pass
NVNT	ac40	5230	5350	-55.35	-55.62	8.23	51.01	Average	54	Pass
NVNT	ac40	5230	5403.84	-45.55	-45.54	8.23	60.95	Peak	68.2	Pass
NVNT	ac40	5230	5350.11	-55.35	-55.18	8.23	51.23	Average	54	Pass
NVNT	ac40	5230	5460	-48.82	-49.11	8.23	57.54	Peak	68.2	Pass
NVNT	ac40	5230	5460	-56.85	-57.25	8.23	49.45	Average	54	Pass
NVNT	ac80	5210	5350	-46.19	-48.39	8.23	59.35	Peak	68.2	Pass
NVNT	ac80	5210	5350	-56.49	-56.03	8.23	50.24	Average	54	Pass
NVNT	ac80	5210	5450.43	-45.75	-46.29	8.23	60.49	Peak	68.2	Pass
NVNT	ac80	5210	5384.1	-55.65	-55.36	8.23	51.00	Average	54	Pass
NVNT	ac80	5210	5460	-48.28	-47.84	8.23	58.44	Peak	68.2	Pass
NVNT	ac80	5210	5460	-56.59	-56.72	8.23	49.84	Average	54	Pass
NVNT	ac80	5210	4500	-48.3	-48.99	8.23	57.87	Peak	68.2	Pass
NVNT	ac80	5210	4500	-57.39	-57.67	8.23	48.97	Average	54	Pass
NVNT	ac80	5210	5149.38	-42.17	-40.4	8.23	65.30	Peak	68.2	Pass
NVNT	ac80	5210	5149.38	-52.4	-53.33	8.23	53.66	Average	54	Pass
NVNT	ac80	5210	5150	-42.63	-41.78	8.23	64.31	Peak	68.2	Pass
NVNT	ac80	5210	5150	-53.11	-53.59	8.23	53.15	Average	54	Pass
NVNT	ax20	5180	4500	-48.36	-49.47	8.23	57.62	Peak	68.2	Pass
NVNT	ax20	5180	4500	-57.69	-56.94	8.23	49.20	Average	54	Pass
NVNT	ax20	5180	5149.6	-41.68	-43.8	8.23	63.89	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	-54.33	-54.1	8.23	52.28	Average	54	Pass
NVNT	ax20	5180	5150	-44.37	-45.61	8.23	61.55	Peak	68.2	Pass
NVNT	ax20	5180	5150	-53.64	-53.23	8.23	53.07	Average	54	Pass
NVNT	ax20	5240	5350	-47.61	-50.51	8.23	57.68	Peak	68.2	Pass
NVNT	ax20	5240	5350	-57.06	-57.03	8.23	49.45	Average	54	Pass
NVNT	ax20	5240	5407.92	-46.24	-46.24	8.23	60.26	Peak	68.2	Pass
NVNT	ax20	5240	5377.44	-56.15	-56.31	8.23	50.27	Average	54	Pass
NVNT	ax20	5240	5460	-48.58	-49.16	8.23	57.64	Peak	68.2	Pass
NVNT	ax20	5240	5460	-56.76	-57.66	8.23	49.31	Average	54	Pass
NVNT	ax40	5190	4500	-48.65	-48.57	8.23	57.89	Peak	68.2	Pass
NVNT	ax40	5190	4500	-57.36	-57.19	8.23	49.22	Average	54	Pass
NVNT	ax40	5190	5146.05	-41.15	-39.12	8.23	66.48	Peak	68.2	Pass
NVNT	ax40	5190	5148.97	-53.74	-53.7	8.23	52.78	Average	54	Pass
NVNT	ax40	5190	5150	-42.83	-39.12	8.23	65.91	Peak	68.2	Pass
NVNT	ax40	5190	5150	-54.16	-53.7	8.23	52.57	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5350	-49.39	-50.19	8.23	56.73	Peak	68.2	Pass
NVNT	ax40	5230	5350	-56.9	-57.25	8.23	49.43	Average	54	Pass
NVNT	ax40	5230	5435.43	-45.09	-46.65	8.23	60.70	Peak	68.2	Pass
NVNT	ax40	5230	5450.28	-56.36	-56.31	8.23	50.16	Average	54	Pass
NVNT	ax40	5230	5460	-49.54	-48.98	8.23	57.25	Peak	68.2	Pass
NVNT	ax40	5230	5460	-57.06	-56.81	8.23	49.56	Average	54	Pass
NVNT	ax80	5210	5350	-49.57	-48.84	8.23	57.31	Peak	68.2	Pass
NVNT	ax80	5210	5350	-56.63	-56.35	8.23	50.01	Average	54	Pass
NVNT	ax80	5210	5367.6	-46.22	-46.17	8.23	60.30	Peak	68.2	Pass
NVNT	ax80	5210	5361.99	-55.72	-55.69	8.23	50.79	Average	54	Pass
NVNT	ax80	5210	5460	-48.4	-49.25	8.23	57.69	Peak	68.2	Pass
NVNT	ax80	5210	5460	-56.96	-56.73	8.23	49.65	Average	54	Pass
NVNT	ax80	5210	4500	-49.4	-48.82	8.23	57.40	Peak	68.2	Pass
NVNT	ax80	5210	4500	-57.23	-57.46	8.23	49.15	Average	54	Pass
NVNT	ax80	5210	5147.01	-43.4	-41.84	8.23	63.95	Peak	68.2	Pass
NVNT	ax80	5210	5149.38	-53.32	-53.08	8.23	53.30	Average	54	Pass
NVNT	ax80	5210	5150	-43.13	-44.2	8.23	62.87	Peak	68.2	Pass
NVNT	ax80	5210	5150	-53.34	-53.79	8.23	52.94	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant3	5200	0	0	25	Pass
NVNT	a	5240	Ant3	5240	0	0	25	Pass
NVNT	n20	5180	Ant3	5180	0	0	25	Pass
NVNT	n20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant3	5240	0	0	25	Pass
NVNT	n40	5190	Ant3	5190	0	0	25	Pass
NVNT	n40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant3	5190	0	0	25	Pass
NVNT	ac40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac80	5210	Ant3	5210	0	0	25	Pass
NVNT	ax20	5180	Ant3	5180.02	20000	3.86	25	Pass
NVNT	ax20	5200	Ant3	5200	0	0	25	Pass
NVNT	ax20	5240	Ant3	5240	0	0	25	Pass
NVNT	ax40	5190	Ant3	5190	0	0	25	Pass
NVNT	ax40	5230	Ant3	5230	0	0	25	Pass
NVNT	ax80	5210	Ant3	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant3

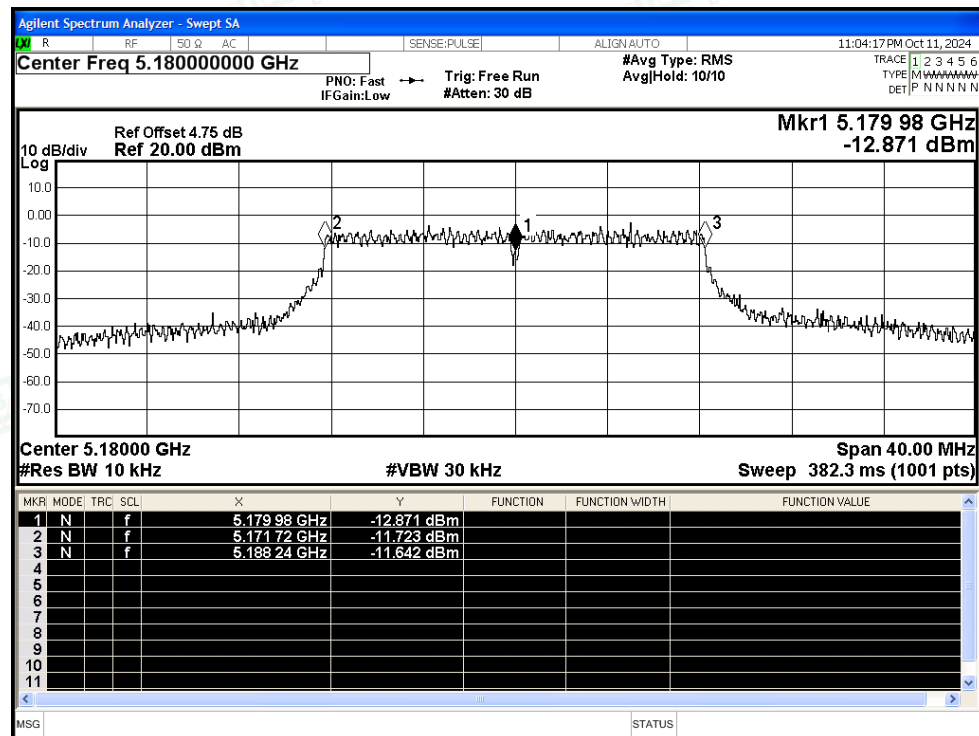


Freq. Stability NVNT a 5200MHz Ant3

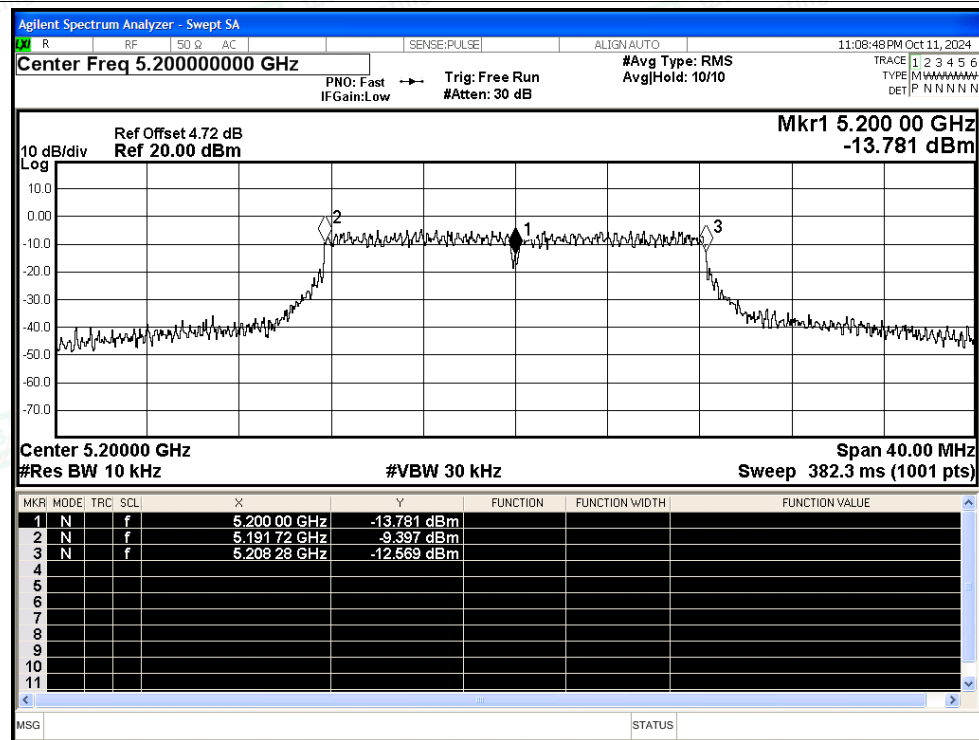




Freq. Stability NVNT a 5240MHz Ant3

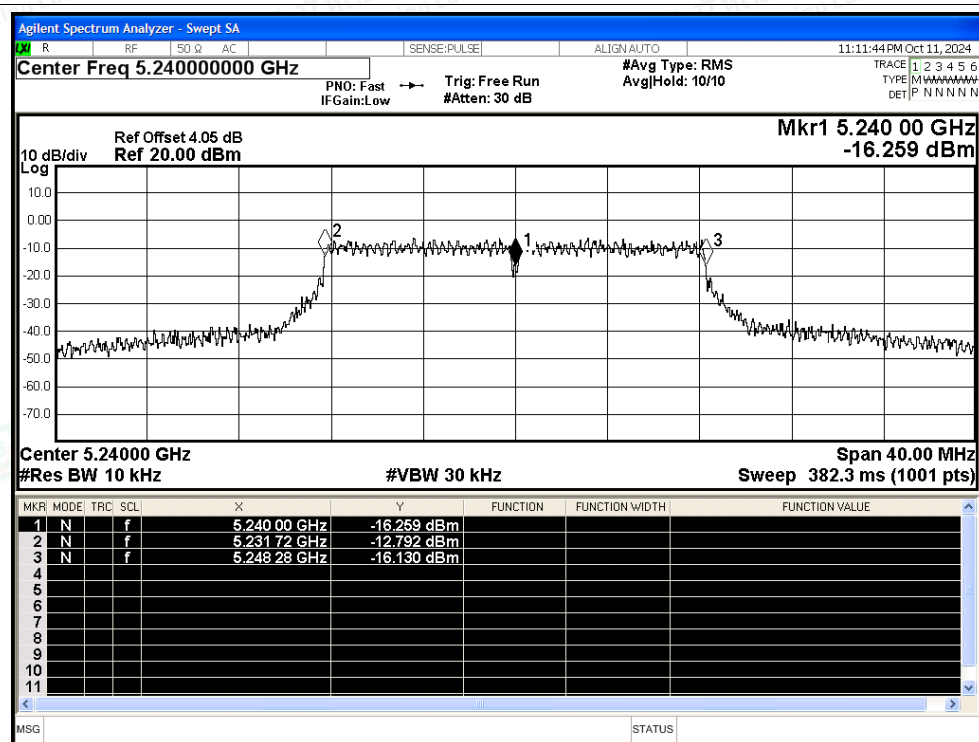


Freq. Stability NVNT n20 5180MHz Ant3

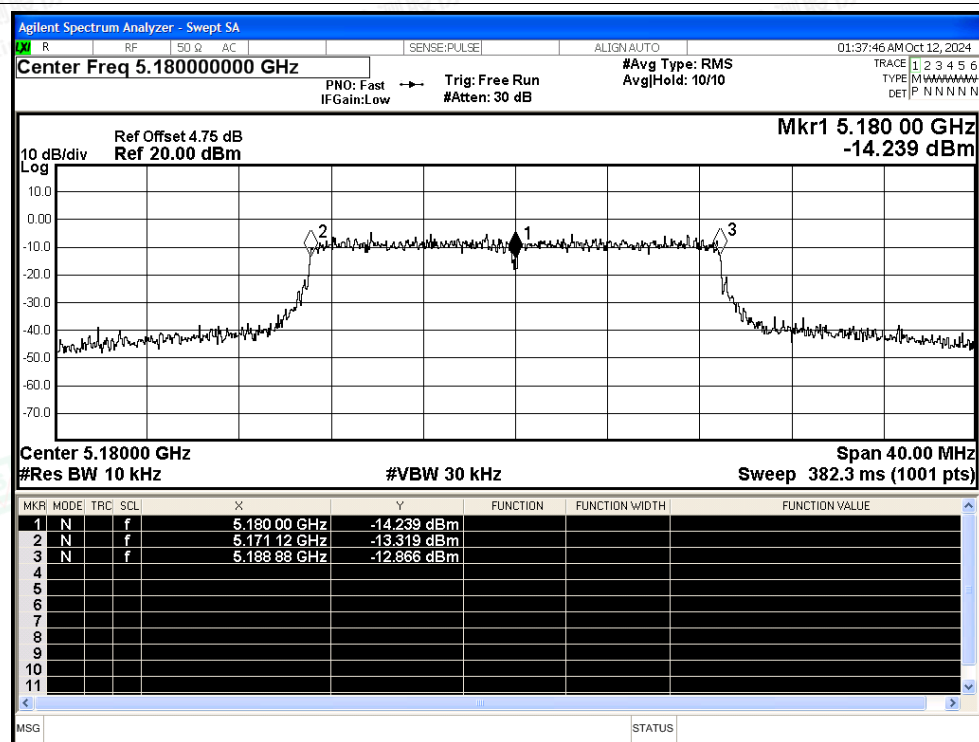




Freq. Stability NVNT n20 5200MHz Ant3

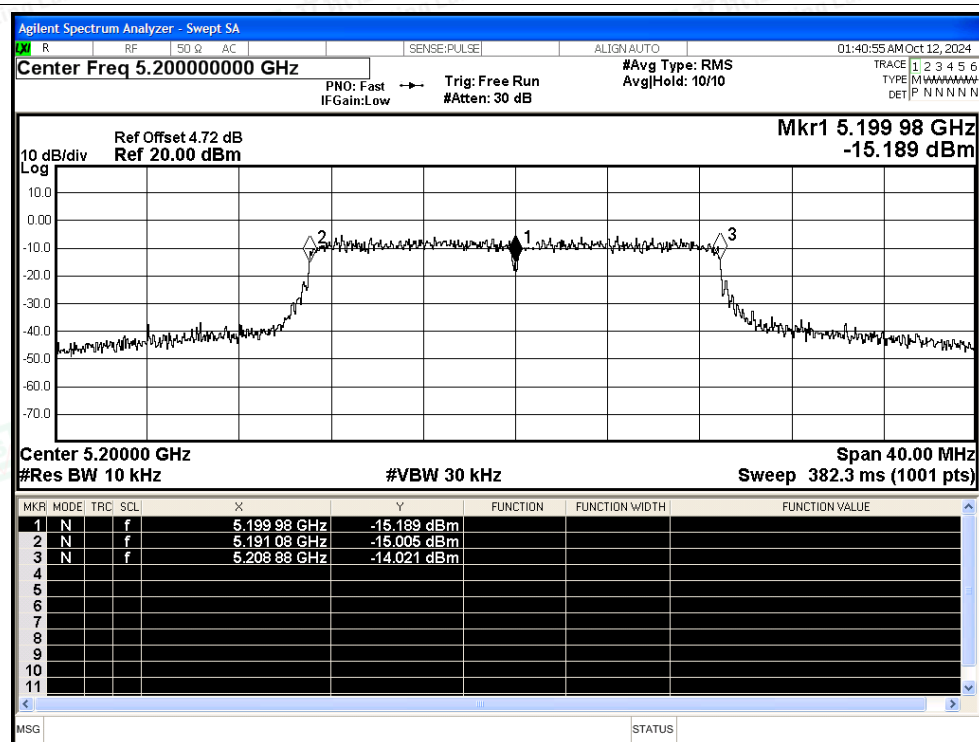

Freq. Stability NVNT n20 5240MHz Ant3

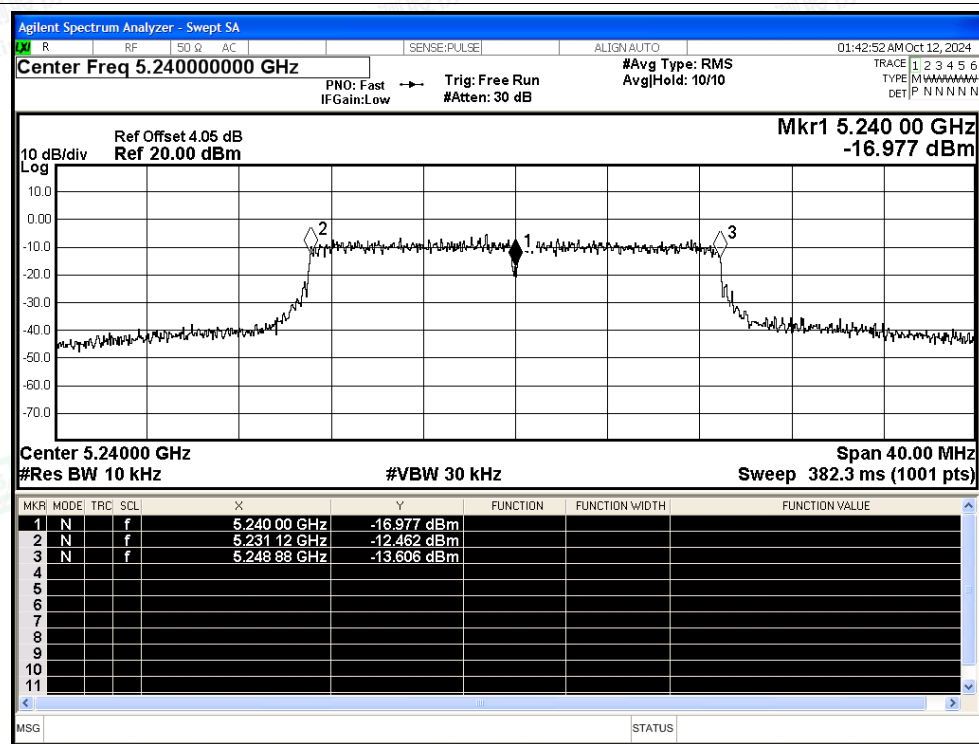

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant3

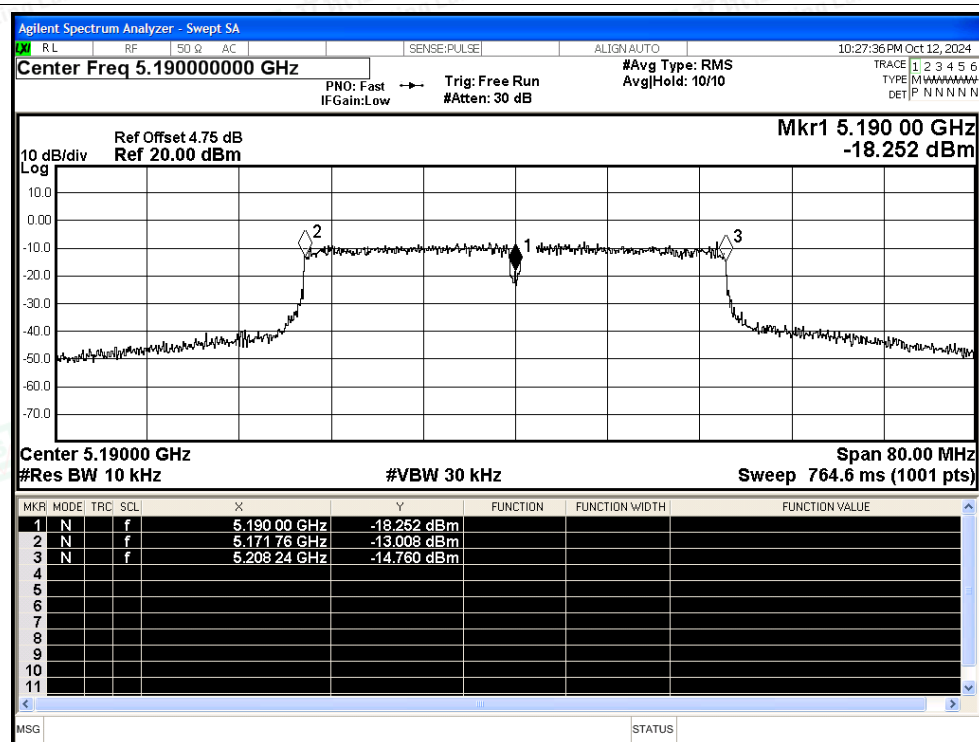


Freq. Stability NVNT n40 5230MHz Ant3

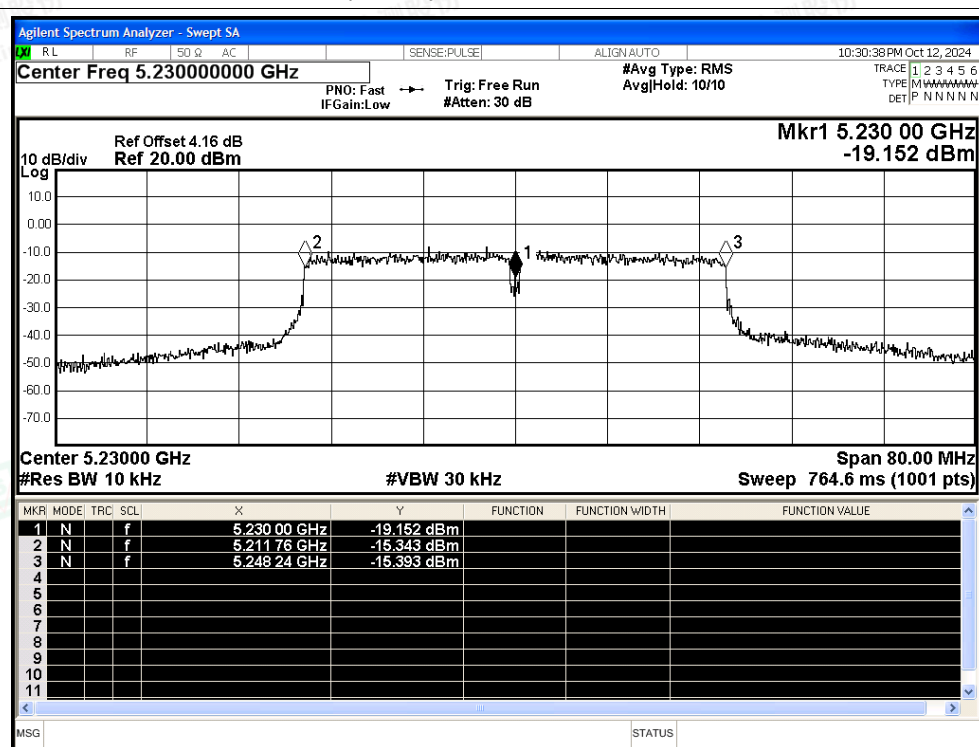




Freq. Stability NVNT ac20 5180MHz Ant3

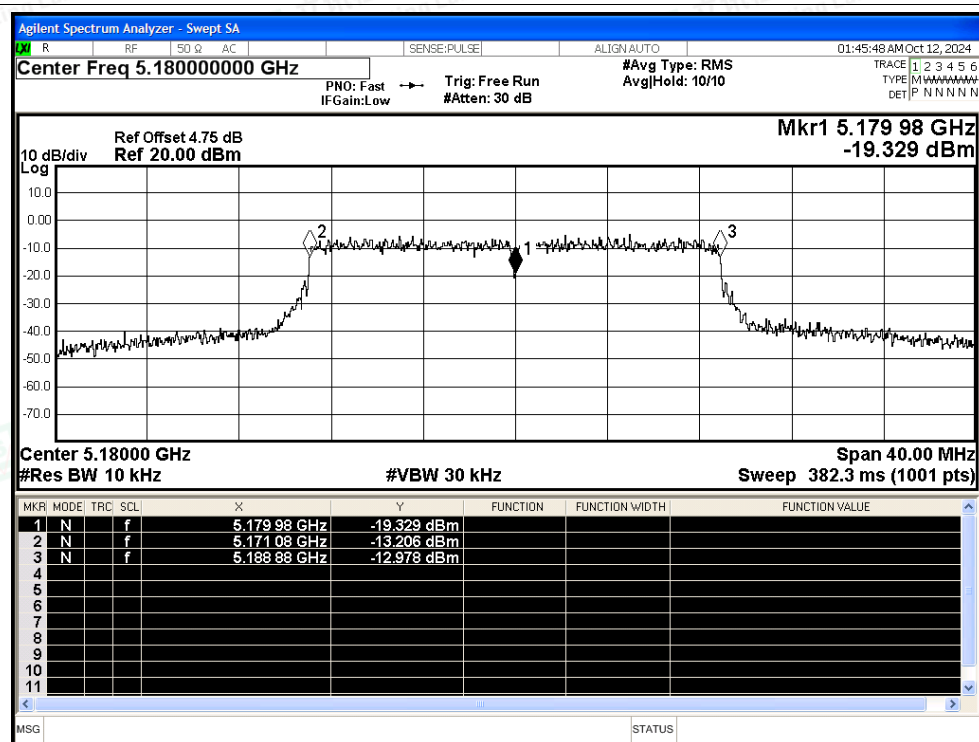


Freq. Stability NVNT ac20 5200MHz Ant3

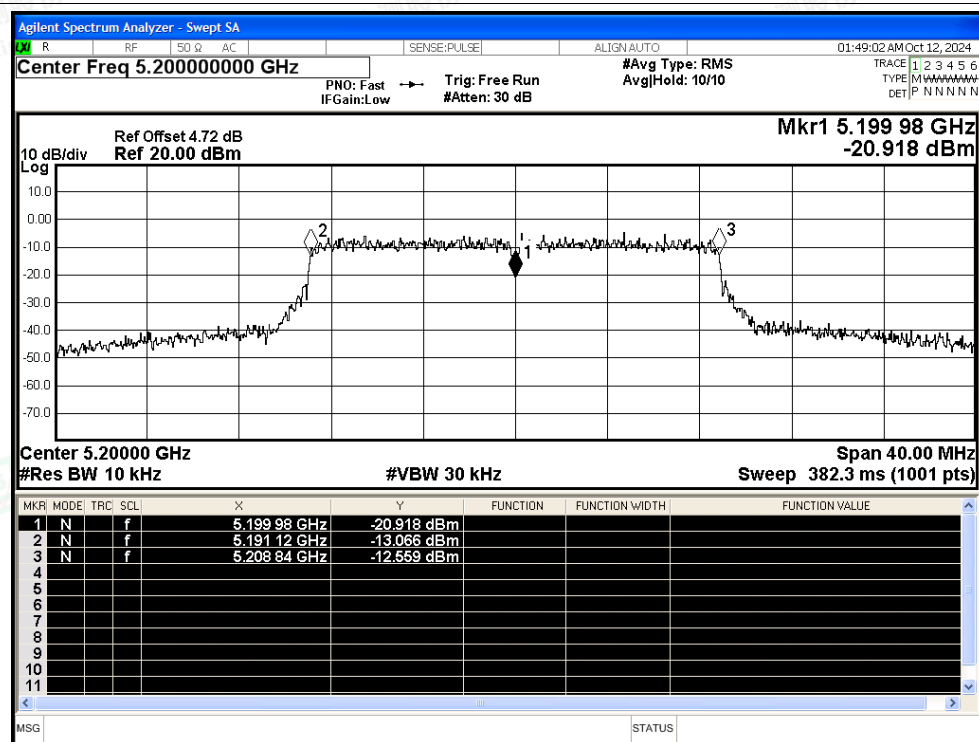




Freq. Stability NVNT ac20 5240MHz Ant3

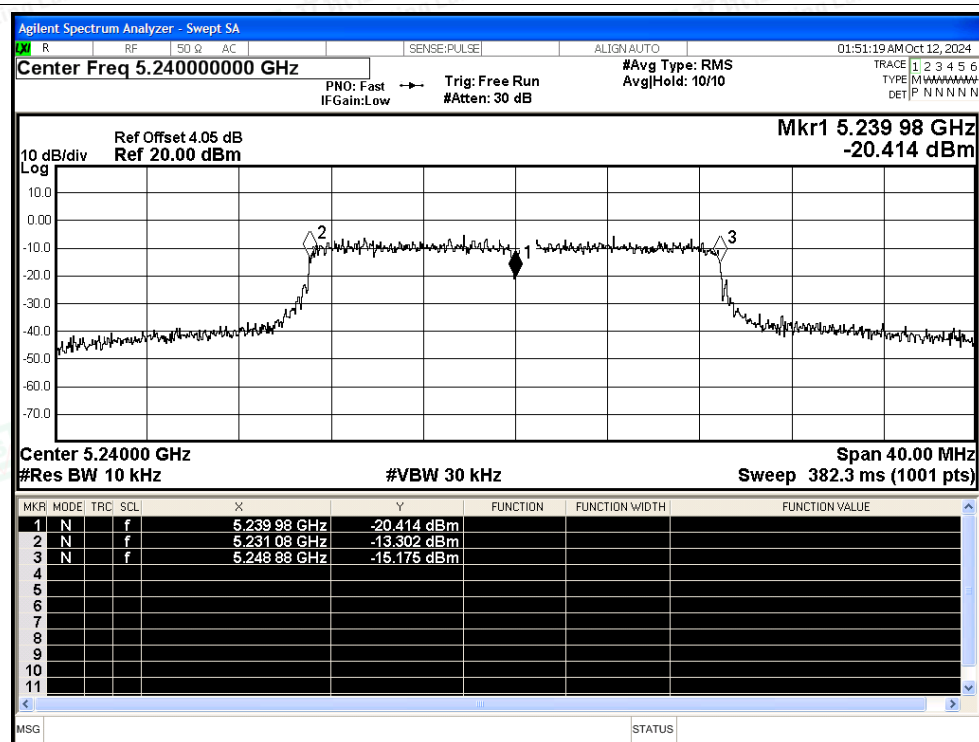


Freq. Stability NVNT ac40 5190MHz Ant3

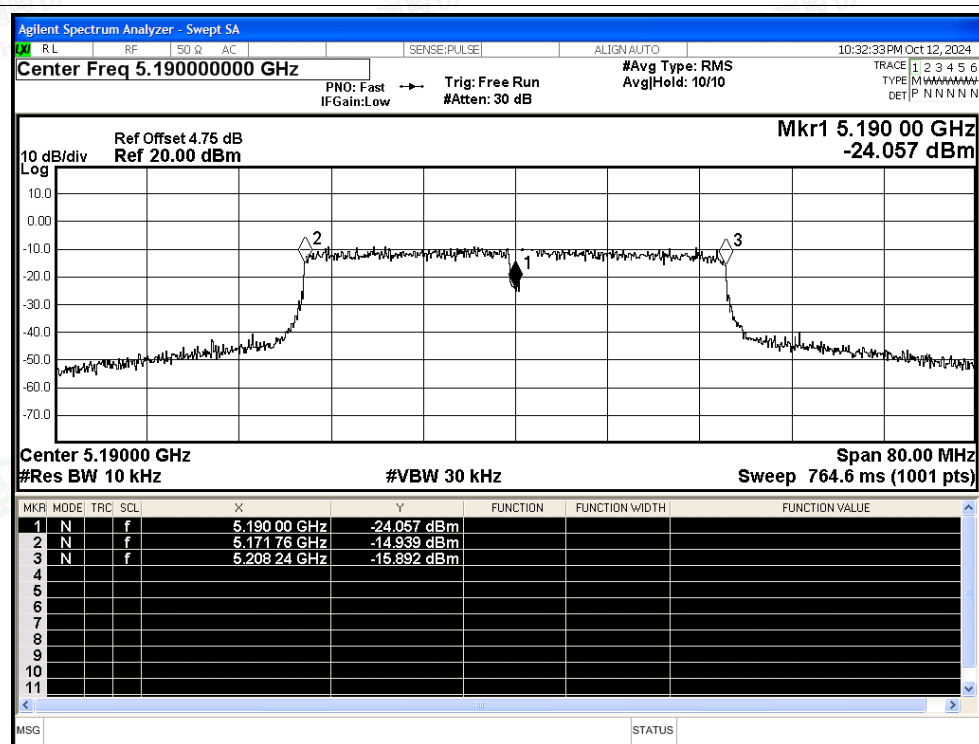




Freq. Stability NVNT ac40 5230MHz Ant3

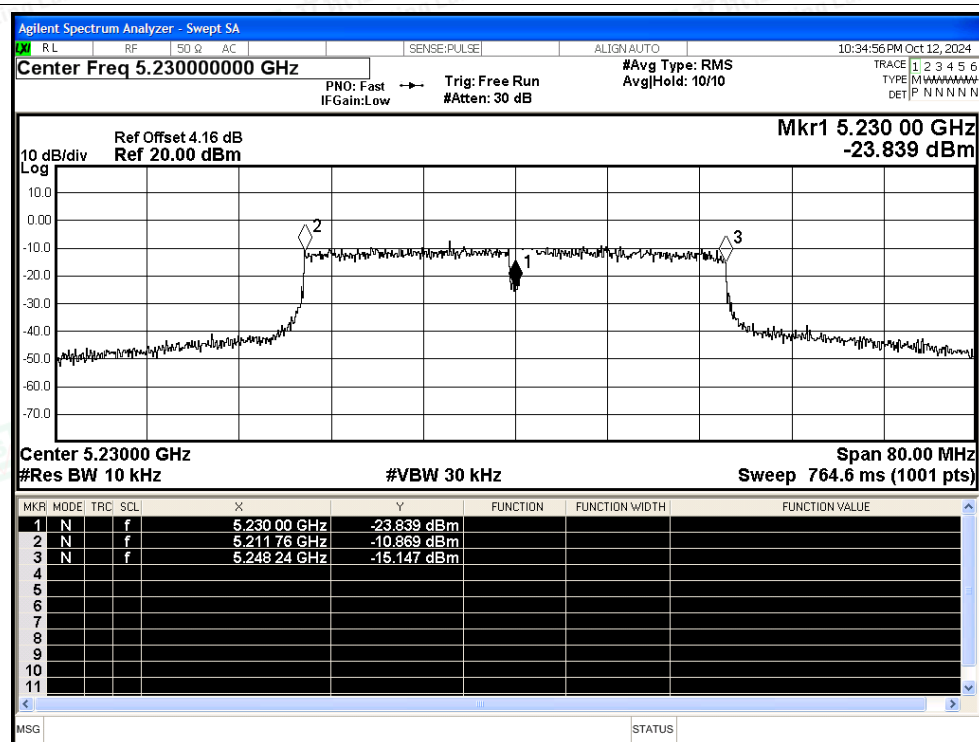

Freq. Stability NVNT ac80 5210MHz Ant3

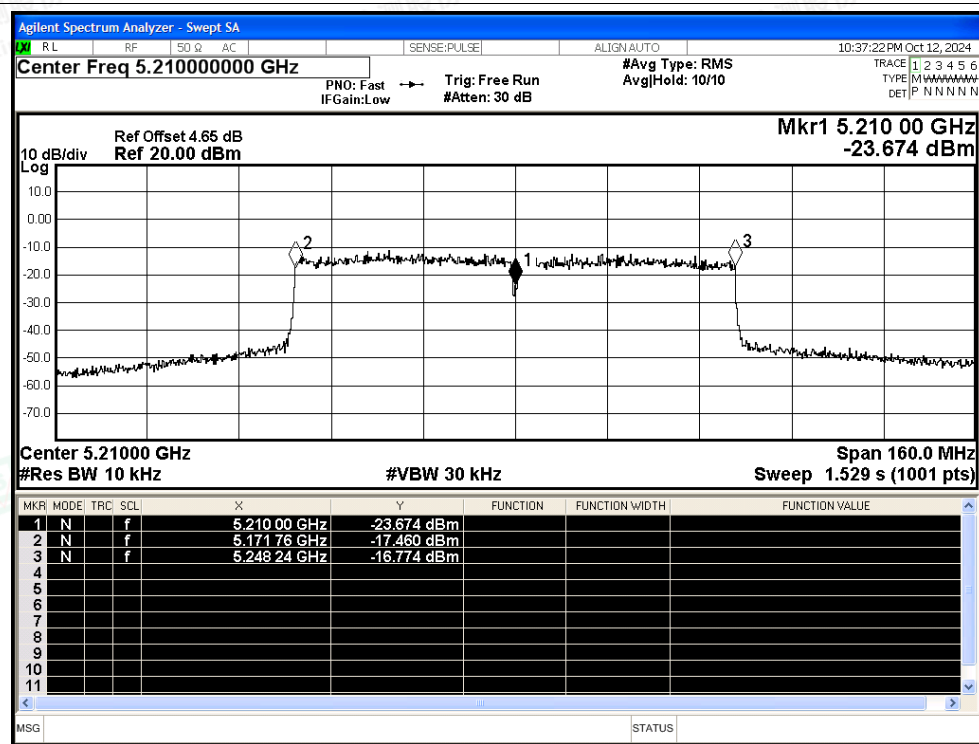

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant3

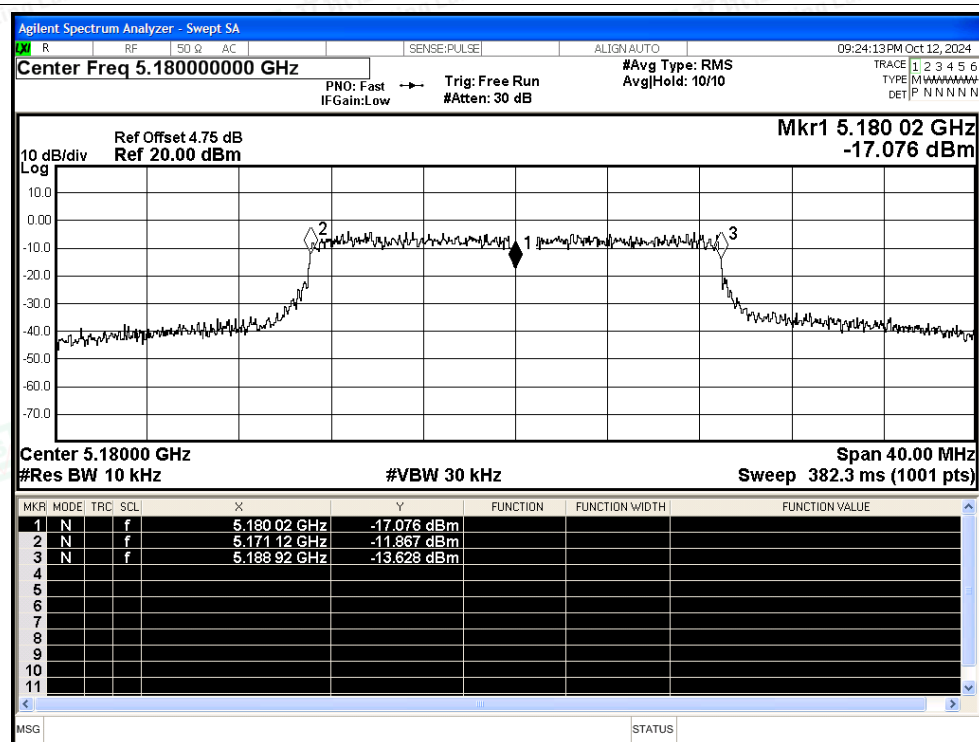

Freq. Stability NVNT ax20 5200MHz Ant3

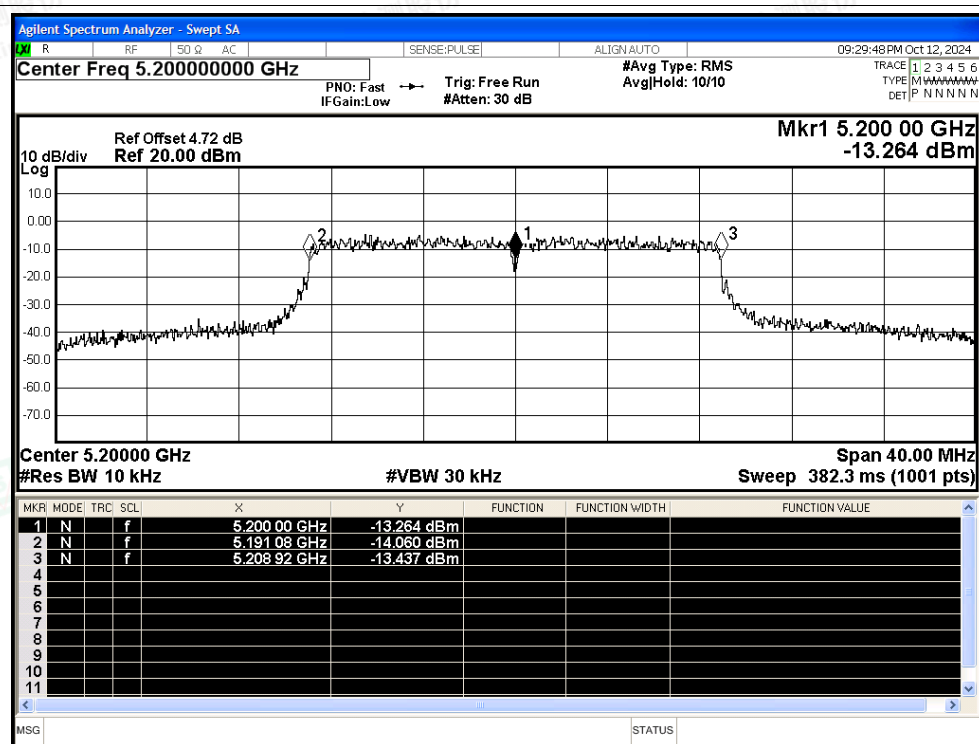

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant3

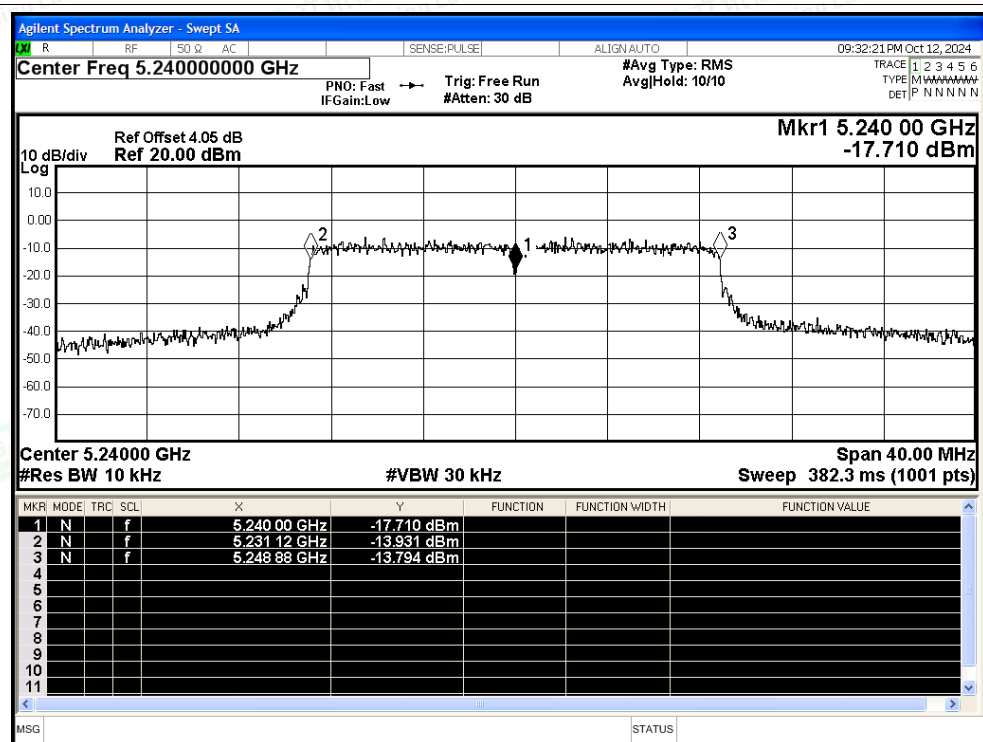


Freq. Stability NVNT ax40 5190MHz Ant3

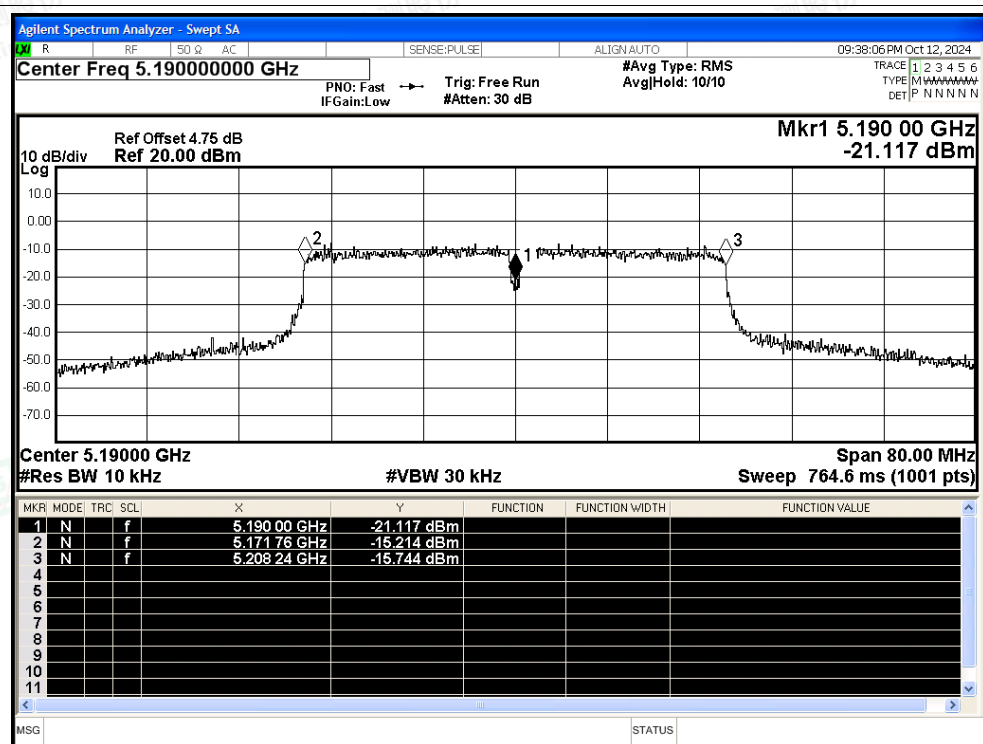




Freq. Stability NVNT ax40 5230MHz Ant3

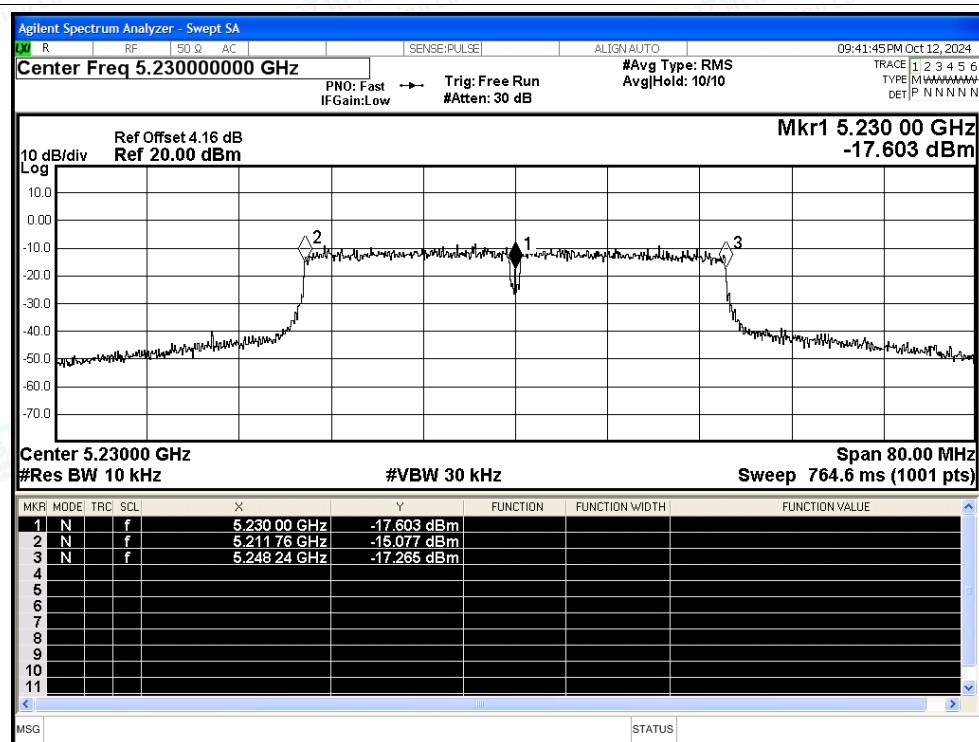

Freq. Stability NVNT ax80 5210MHz Ant3

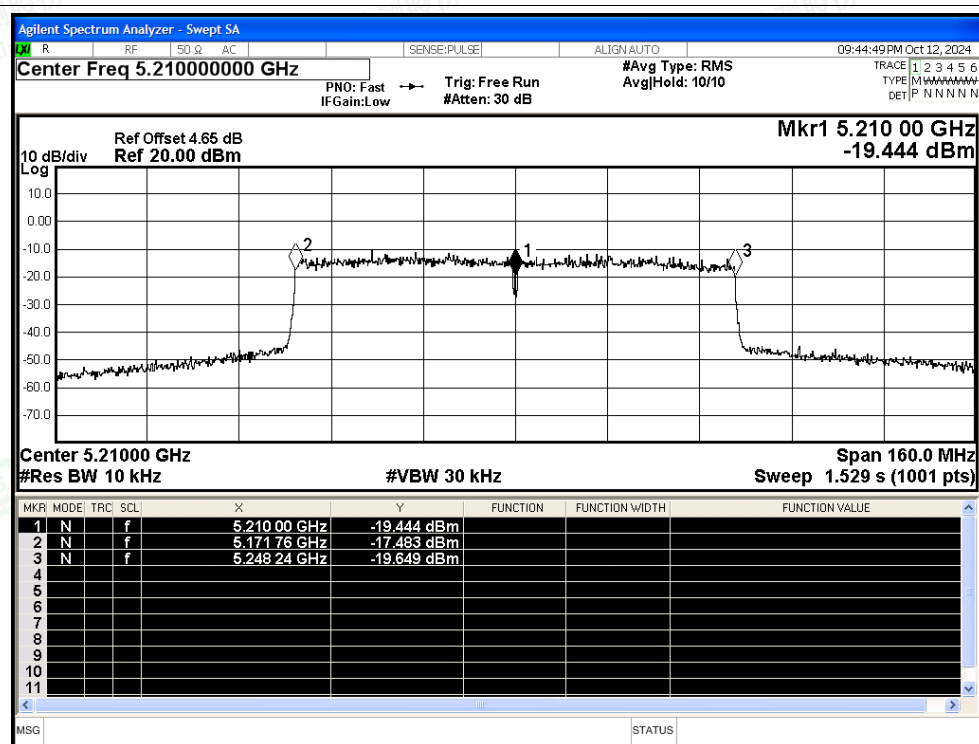

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant4	5200	0	0	25	Pass
NVNT	a	5240	Ant4	5240	0	0	25	Pass
NVNT	n20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant4	5199.96	-40000	-7.69	25	Pass
NVNT	n20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant4	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac20	5180	Ant4	5179.96	-40000	-7.72	25	Pass
NVNT	ac20	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant4	5240	0	0	25	Pass
NVNT	ac40	5190	Ant4	5190	0	0	25	Pass
NVNT	ac40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac80	5210	Ant4	5210	0	0	25	Pass
NVNT	ax20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant4	5200	0	0	25	Pass
NVNT	ax20	5240	Ant4	5240	0	0	25	Pass
NVNT	ax40	5190	Ant4	5190	0	0	25	Pass
NVNT	ax40	5230	Ant4	5230	0	0	25	Pass
NVNT	ax80	5210	Ant4	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant4

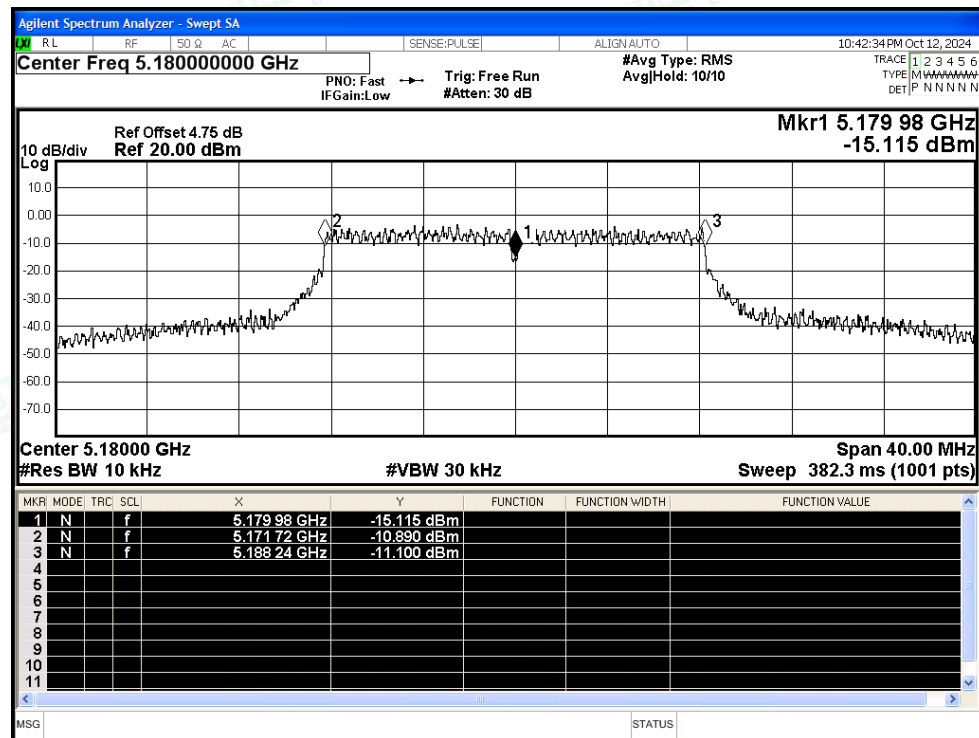


Freq. Stability NVNT a 5200MHz Ant4

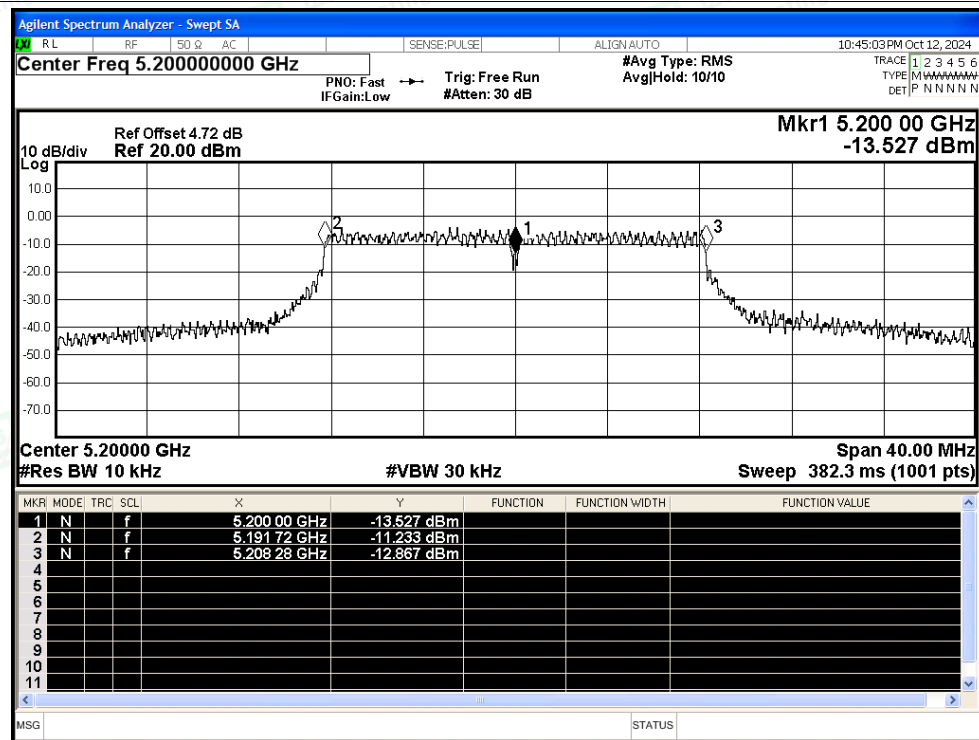




Freq. Stability NVNT a 5240MHz Ant4

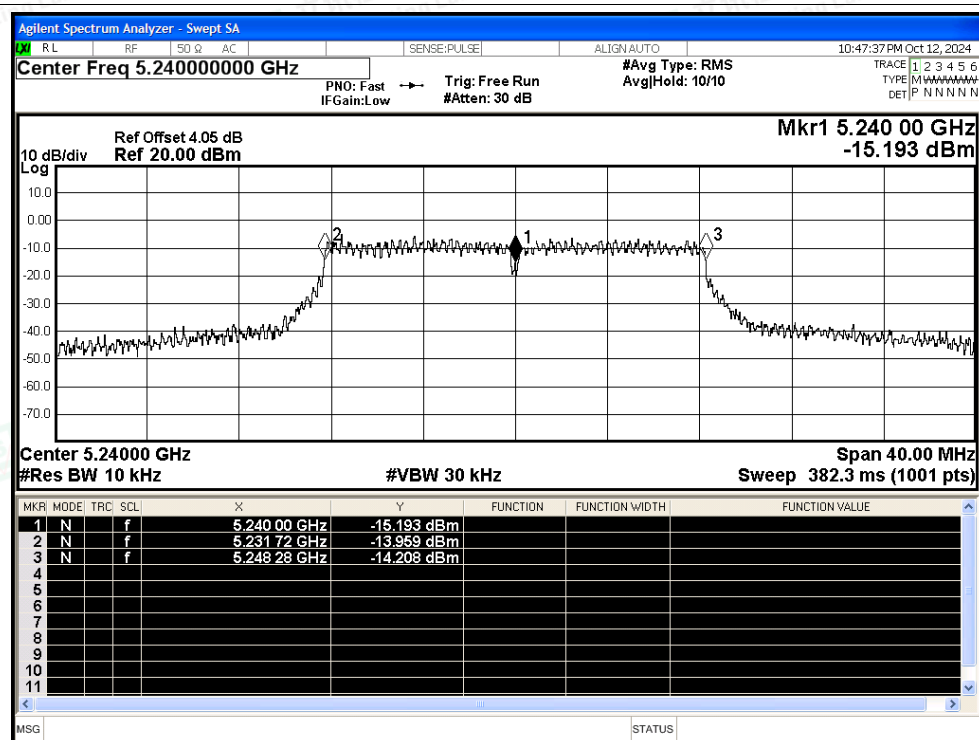


Freq. Stability NVNT n20 5180MHz Ant4

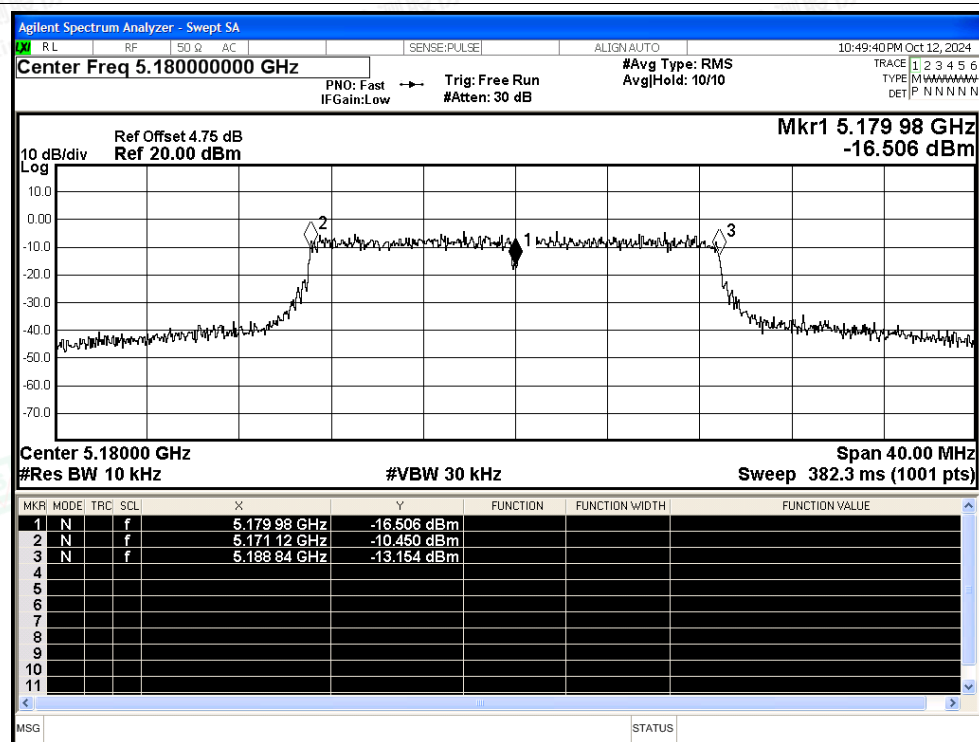




Freq. Stability NVNT n20 5200MHz Ant4

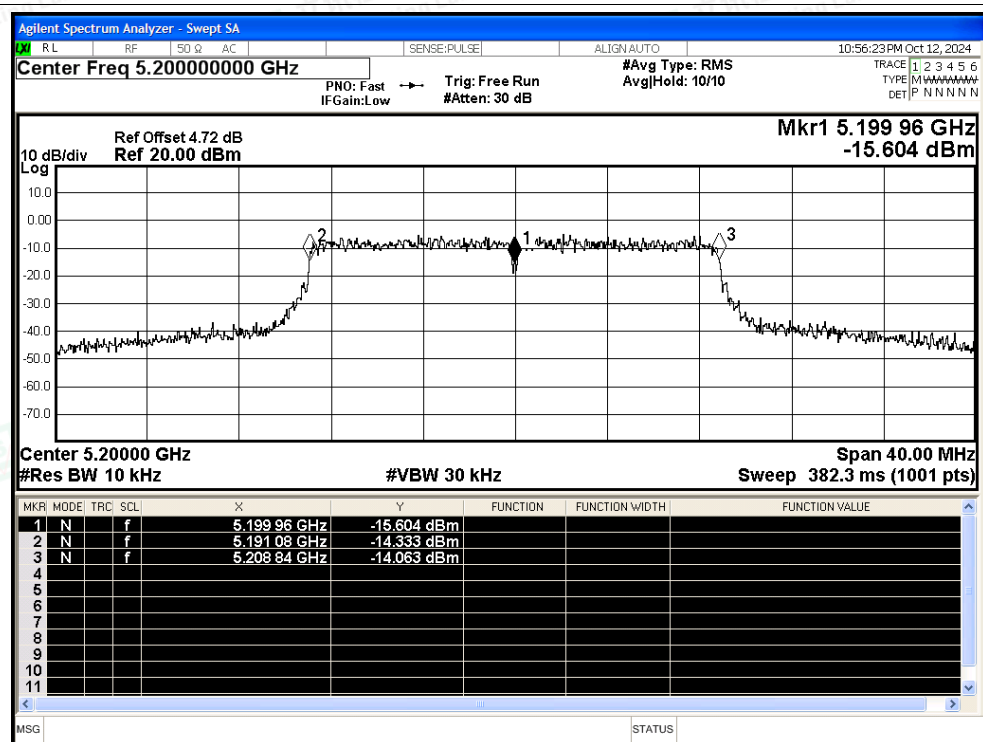


Freq. Stability NVNT n20 5240MHz Ant4

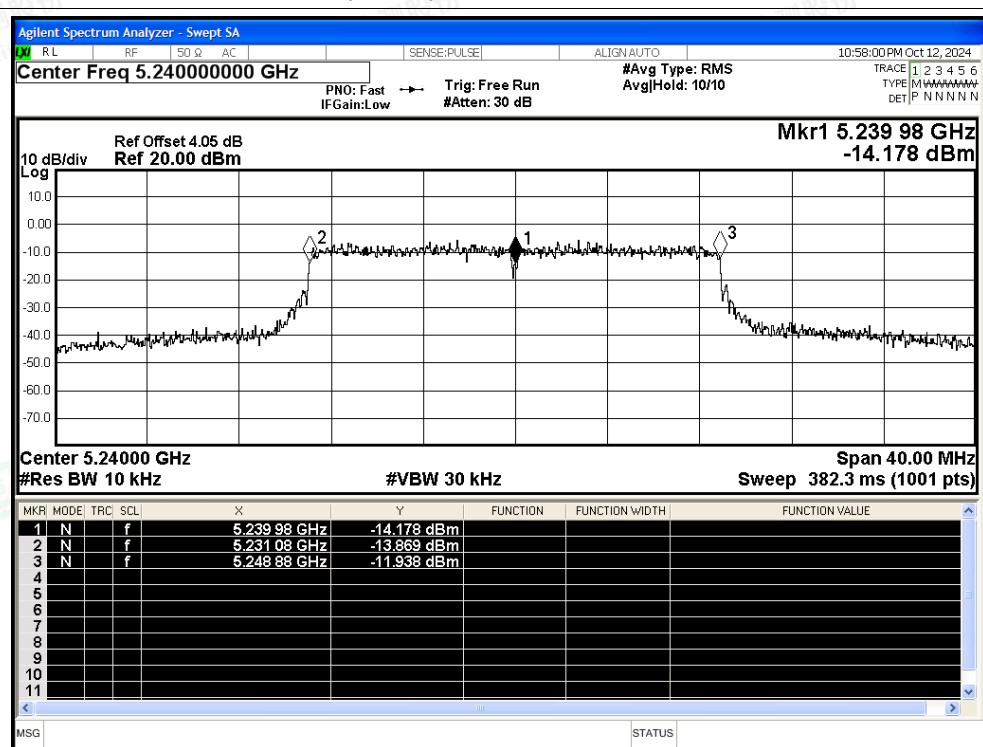




Freq. Stability NVNT n40 5190MHz Ant4

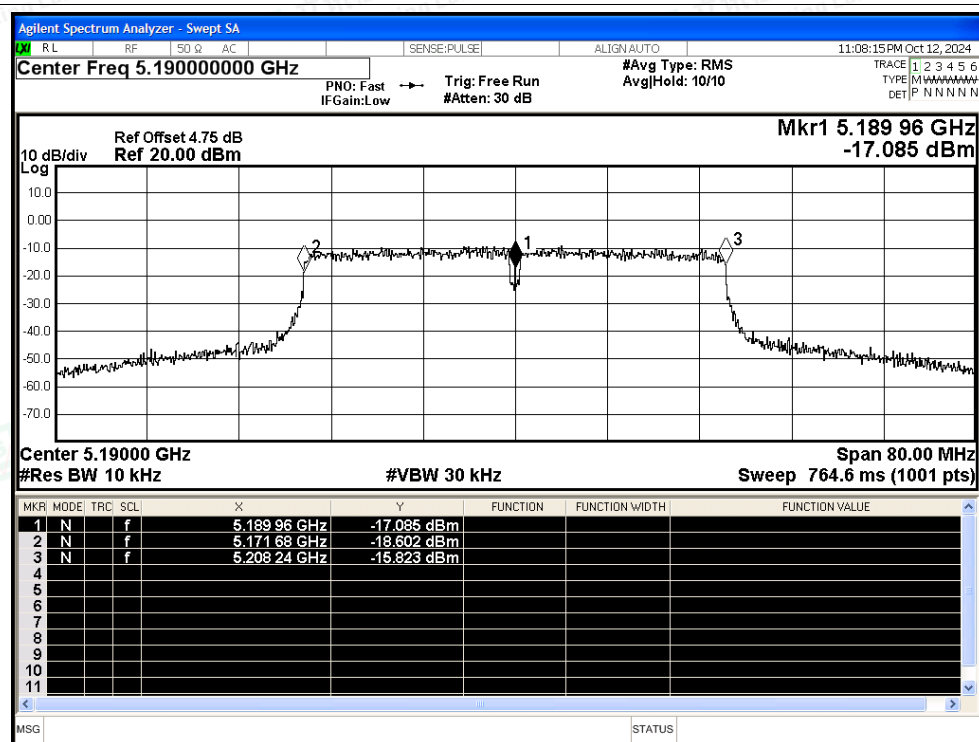


Freq. Stability NVNT n40 5230MHz Ant4

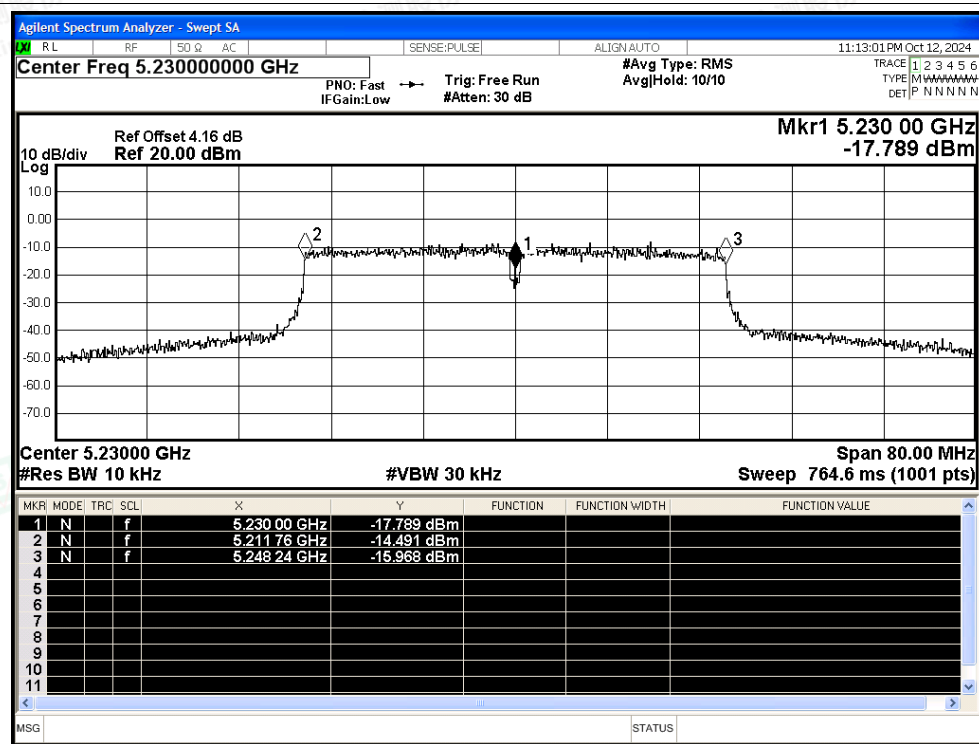




Freq. Stability NVNT ac20 5180MHz Ant4

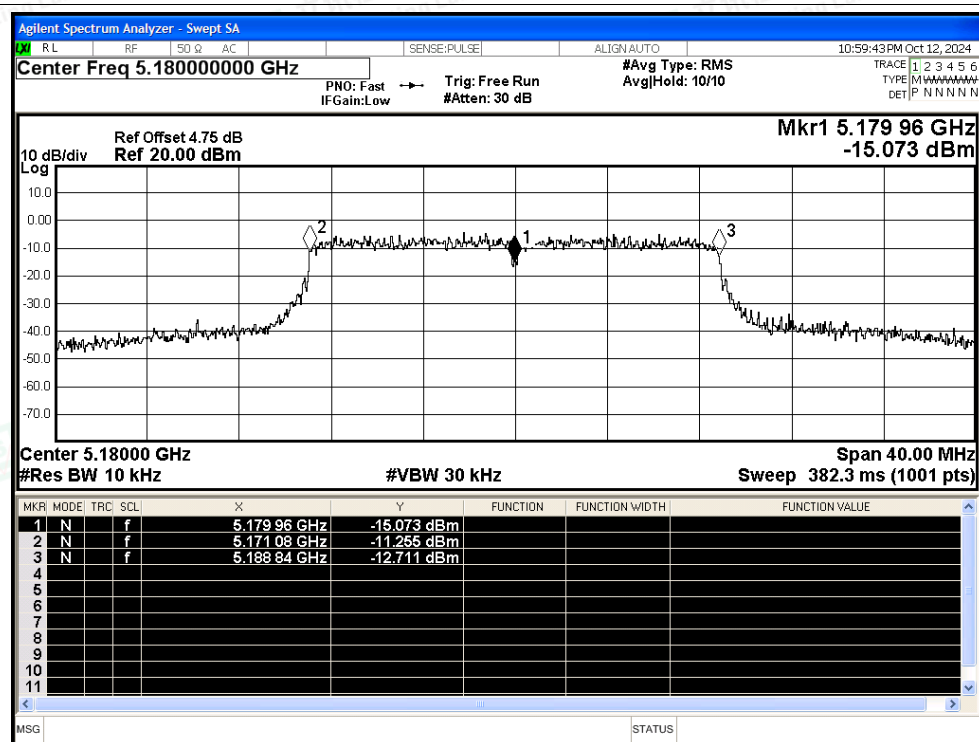


Freq. Stability NVNT ac20 5200MHz Ant4

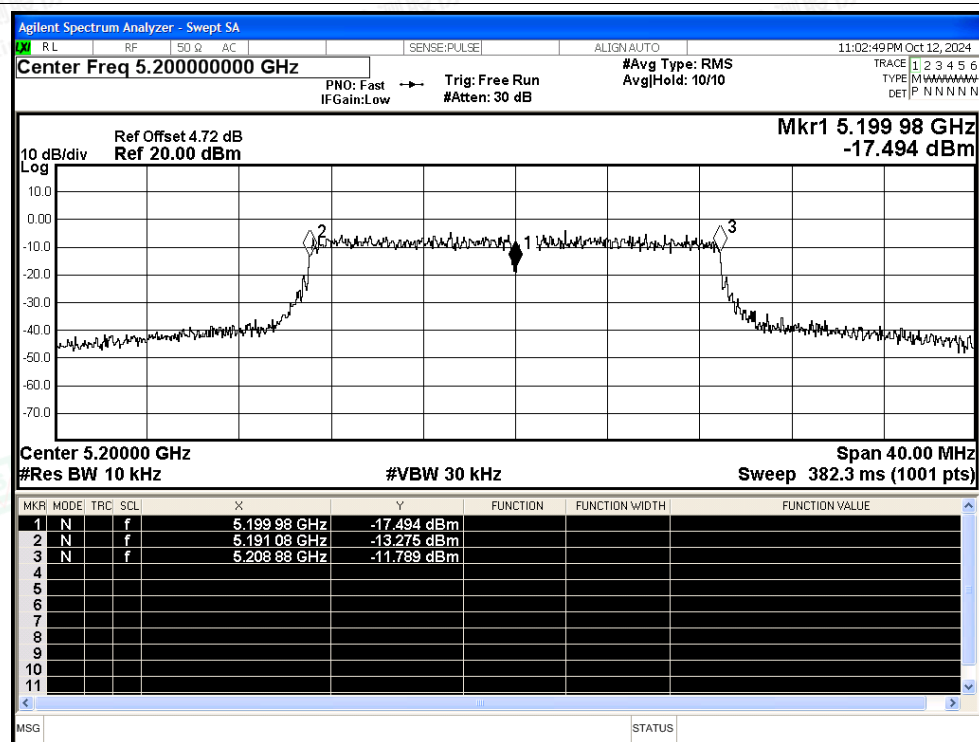




Freq. Stability NVNT ac20 5240MHz Ant4

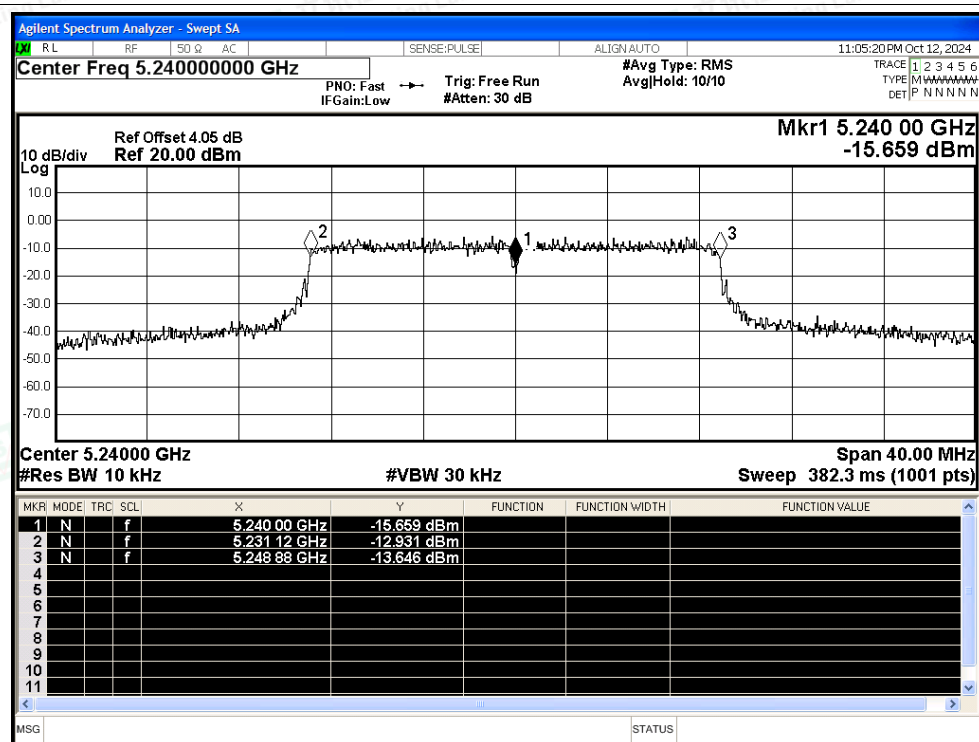

Freq. Stability NVNT ac40 5190MHz Ant4

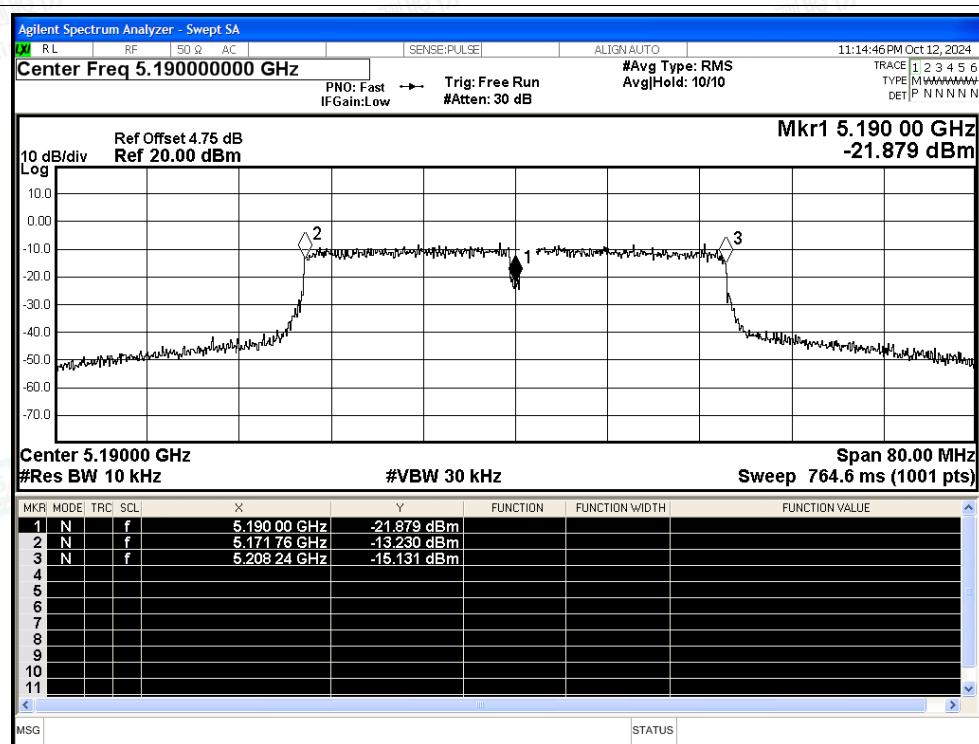

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant4

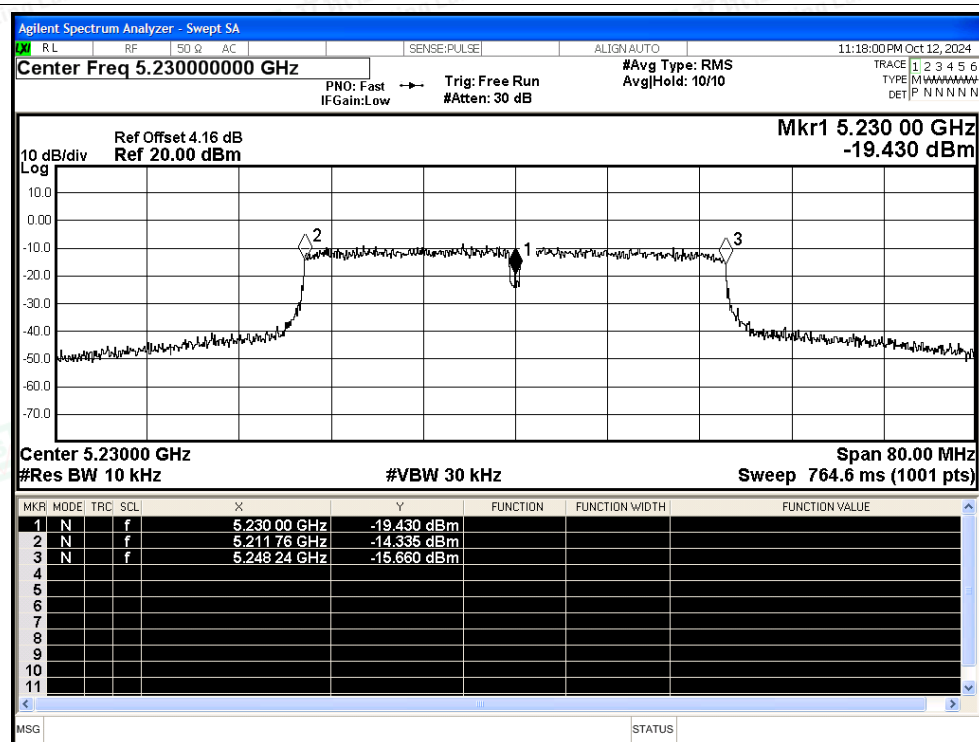


Freq. Stability NVNT ac80 5210MHz Ant4

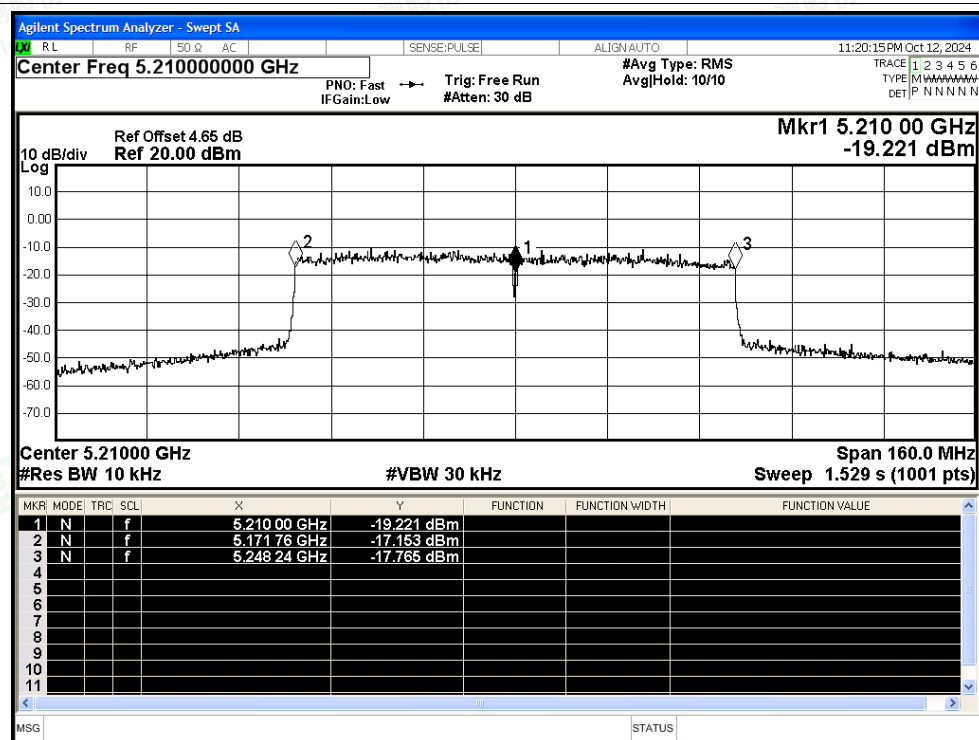


Freq. Stability NVNT ax20 5180MHz Ant4



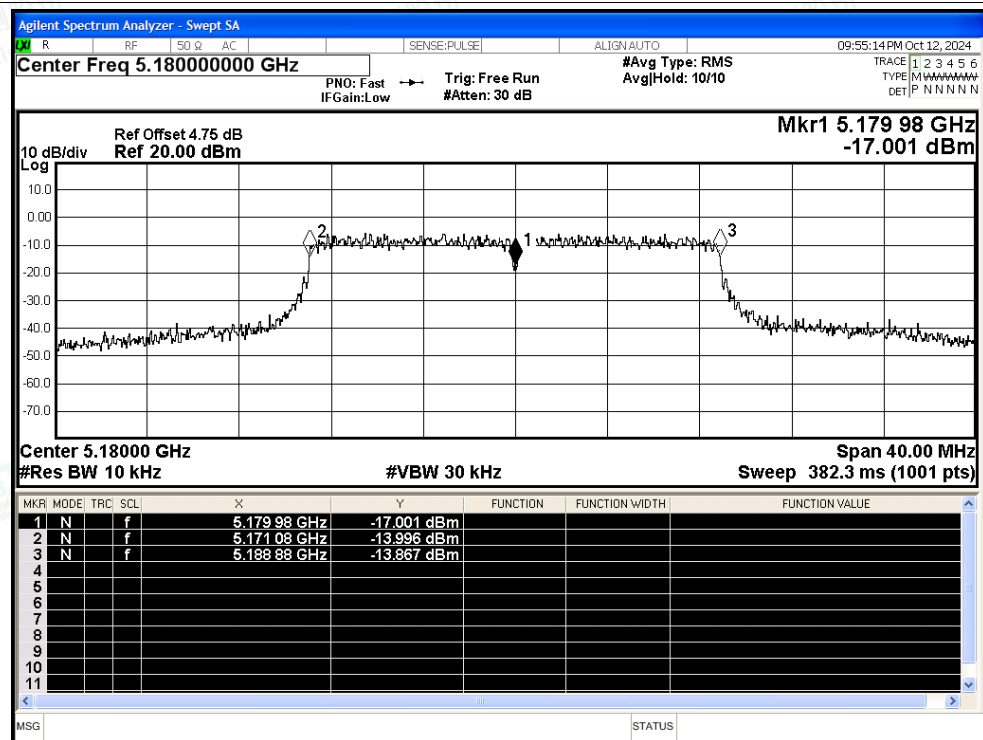


Freq. Stability NVNT ax20 5200MHz Ant4

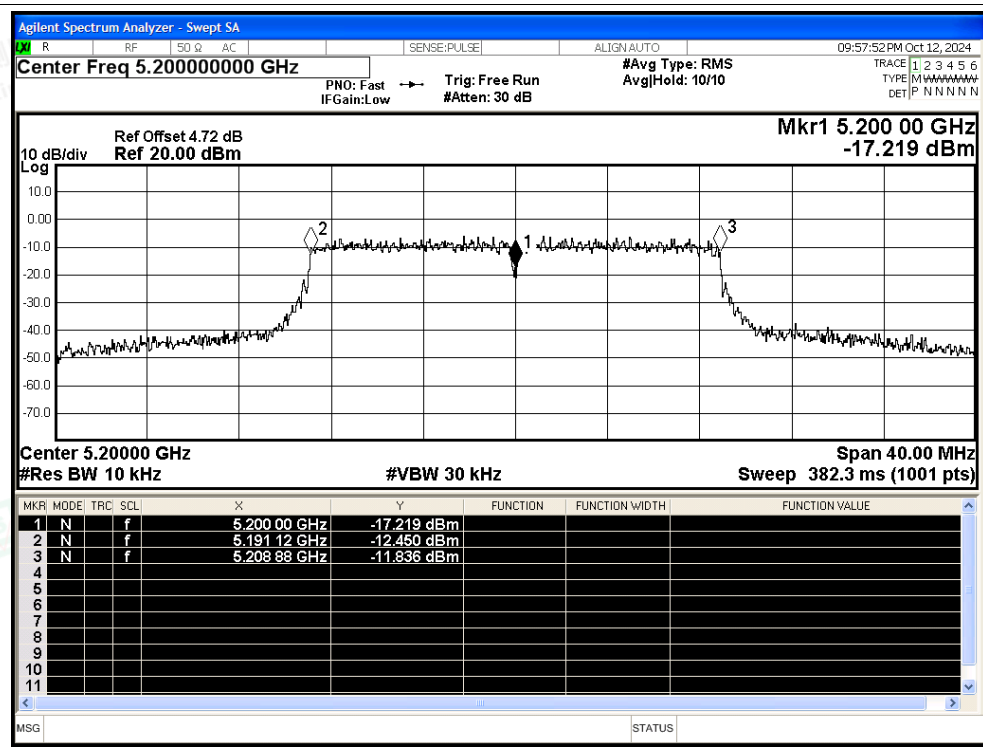




Freq. Stability NVNT ax20 5240MHz Ant4

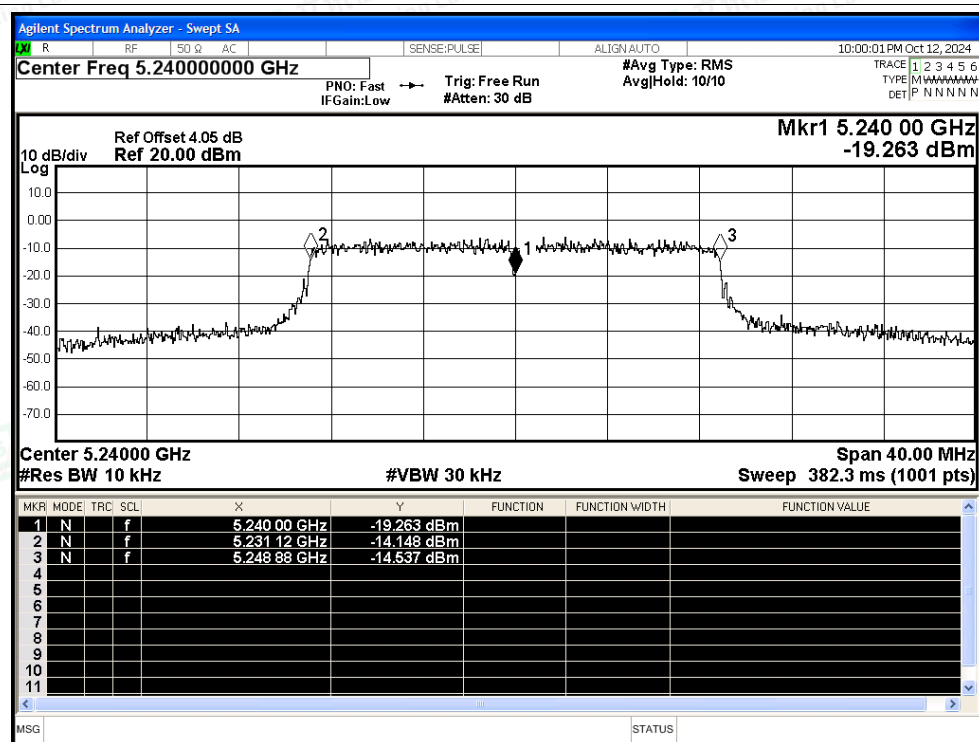


Freq. Stability NVNT ax40 5190MHz Ant4

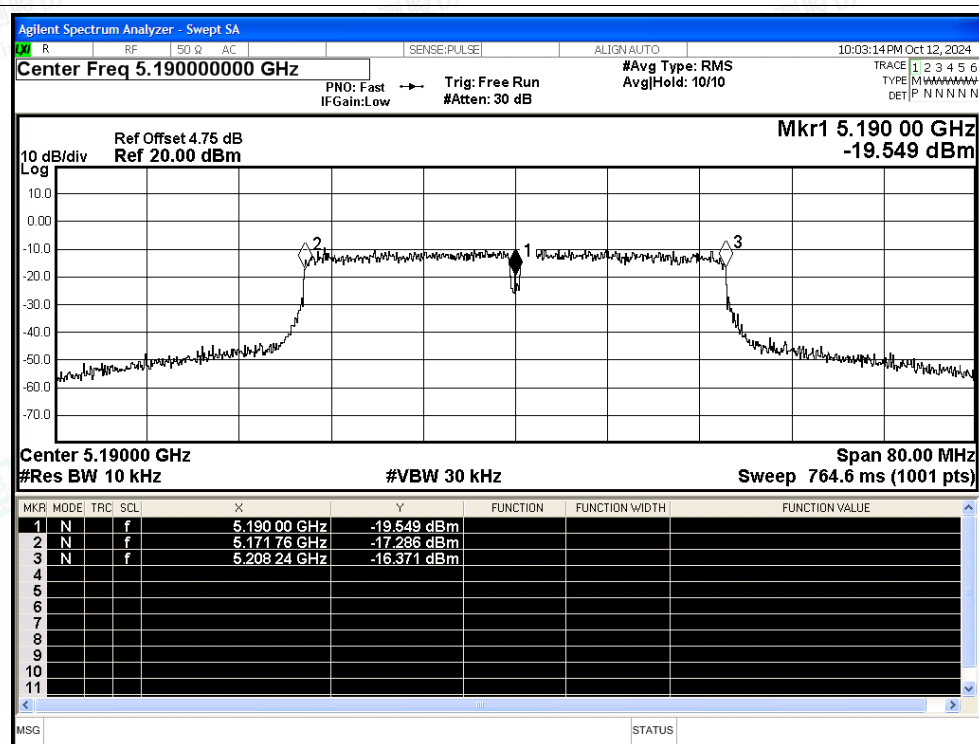




Freq. Stability NVNT ax40 5230MHz Ant4

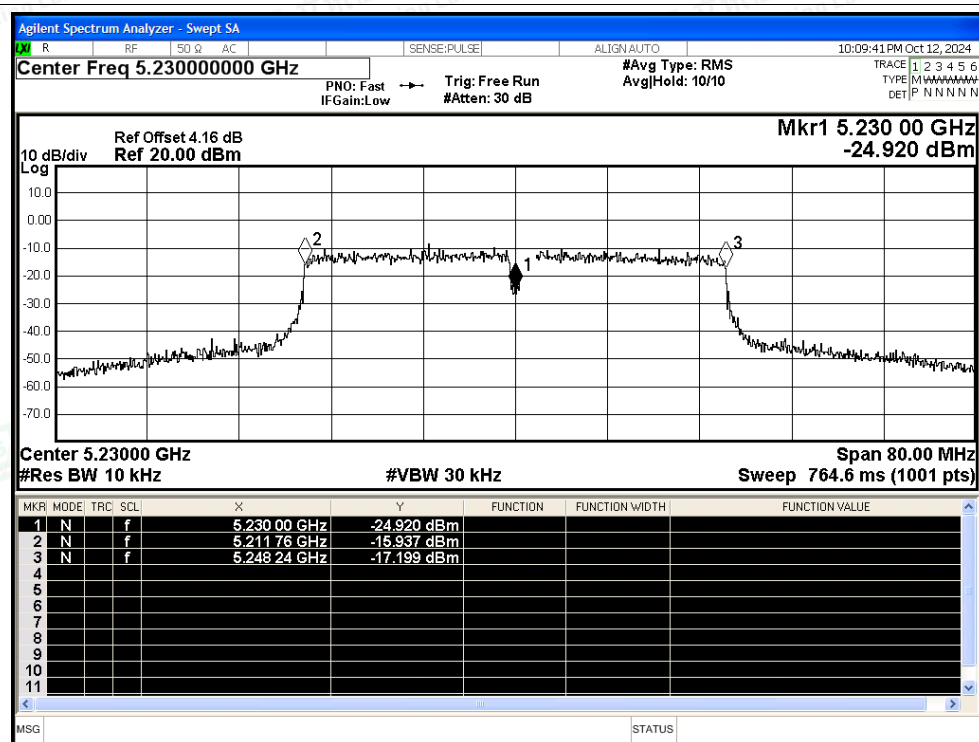

Freq. Stability NVNT ax80 5210MHz Ant4

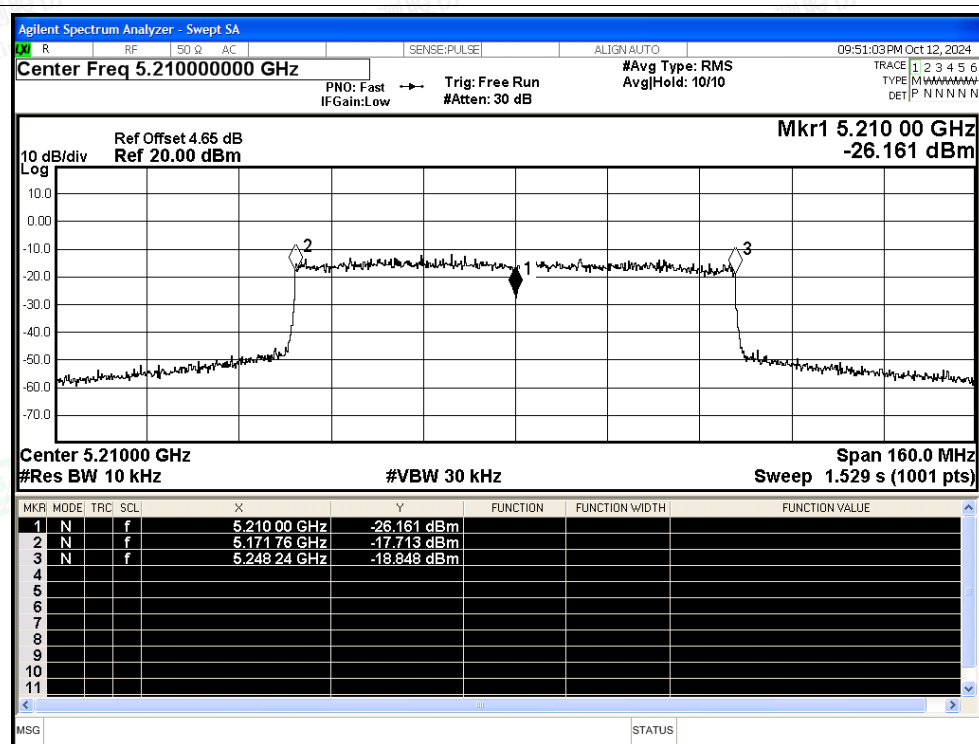



B.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant3	94.65	0.24	0.91
NVNT	a	5200	Ant3	94.56	0.24	0.91
NVNT	a	5240	Ant3	94.65	0.24	0.91
NVNT	n20	5180	Ant3	93.77	0.28	1.07
NVNT	n20	5200	Ant3	93.77	0.28	1.07
NVNT	n20	5240	Ant3	93.77	0.28	1.07
NVNT	n40	5190	Ant3	97.23	0.12	0.46
NVNT	n40	5230	Ant3	97.23	0.12	0.46
NVNT	ac20	5180	Ant3	93.83	0.28	1.06
NVNT	ac20	5200	Ant3	93.72	0.28	1.06
NVNT	ac20	5240	Ant3	93.72	0.28	1.06
NVNT	ac40	5190	Ant3	97.24	0.12	0.46
NVNT	ac40	5230	Ant3	97.24	0.12	0.46
NVNT	ac80	5210	Ant3	94.32	0.25	0.97
NVNT	ax20	5180	Ant3	93.72	0.28	1.06
NVNT	ax20	5200	Ant3	93.72	0.28	1.06
NVNT	ax20	5240	Ant3	93.82	0.28	1.06
NVNT	ax40	5190	Ant3	97.24	0.12	0.46
NVNT	ax40	5230	Ant3	97.19	0.12	0.46
NVNT	ax80	5210	Ant3	94.32	0.25	0.97






Test Graphs

Duty Cycle NVNT a 5180MHz Ant3

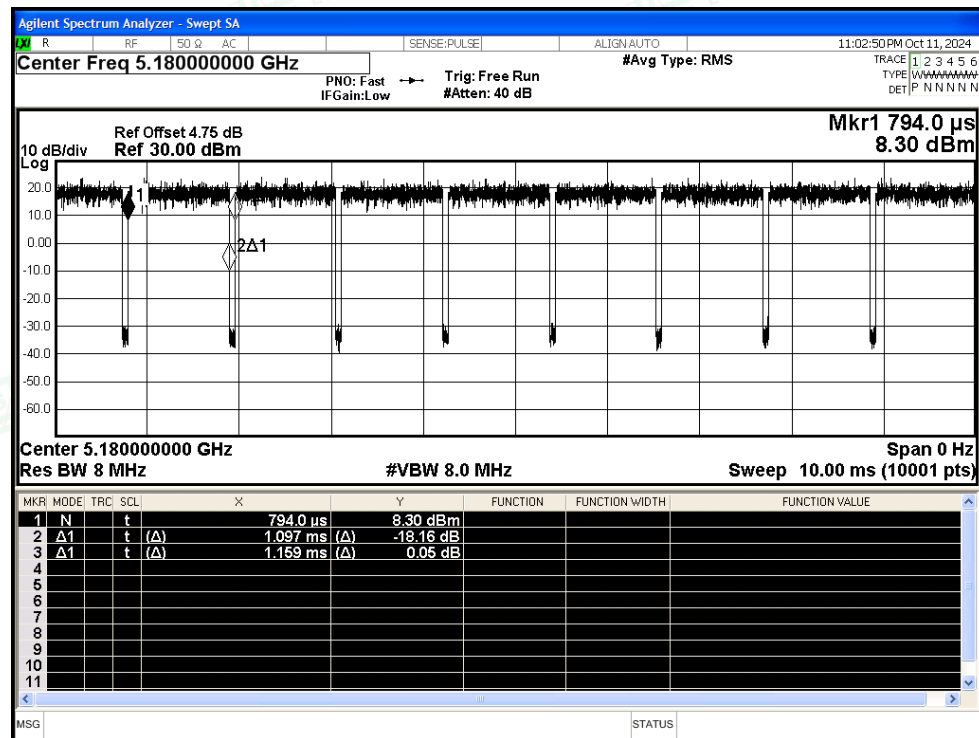


Duty Cycle NVNT a 5200MHz Ant3

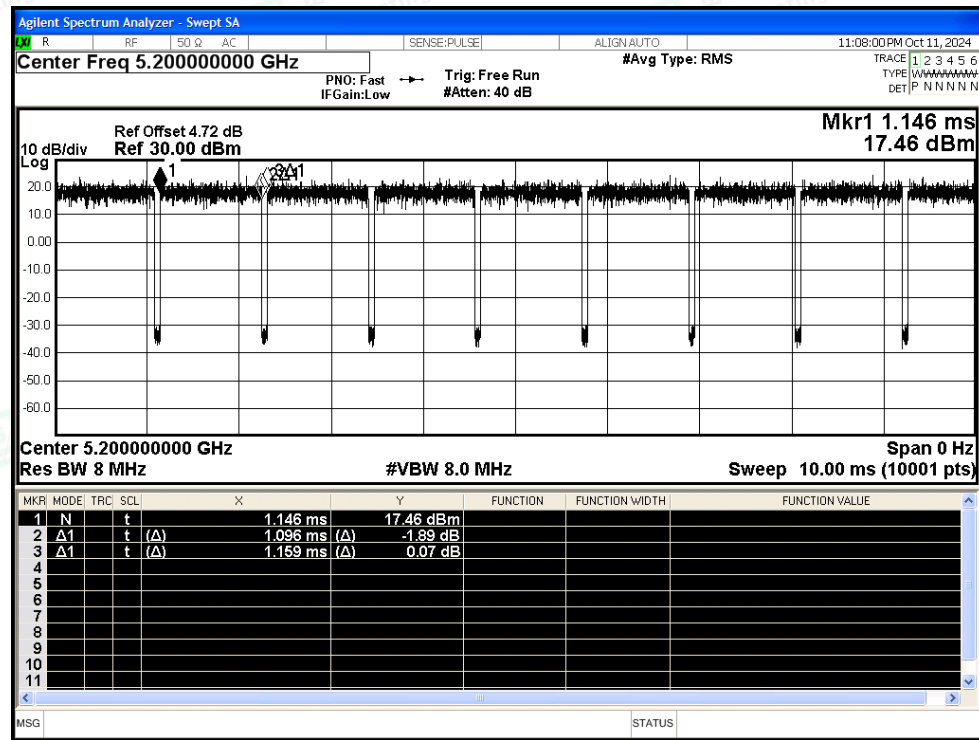




Duty Cycle NVNT a 5240MHz Ant3

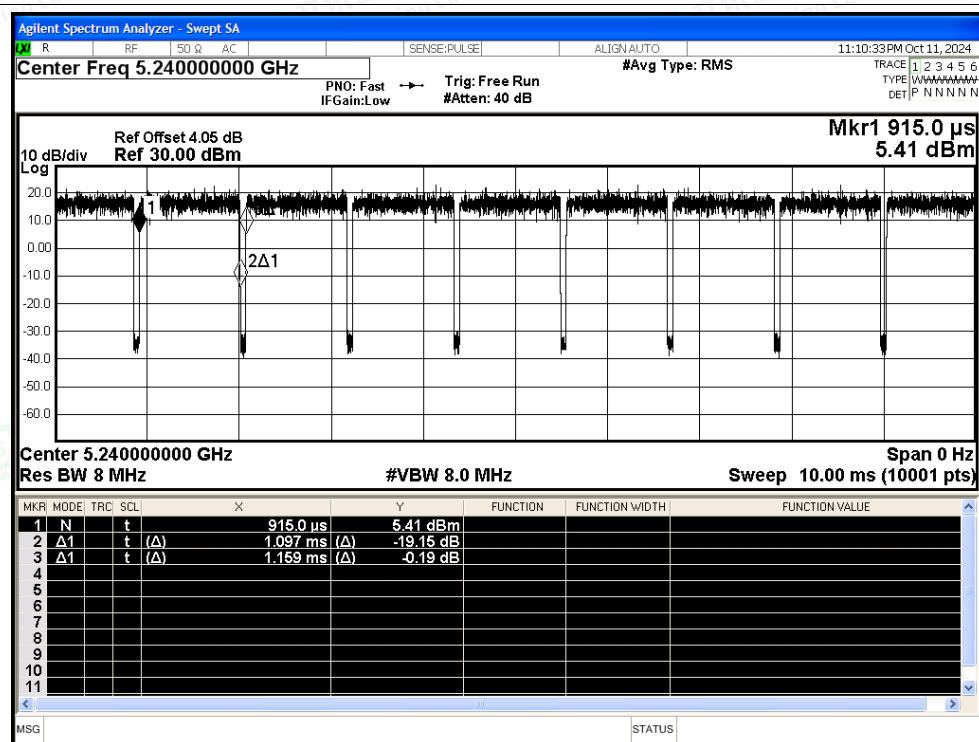


Duty Cycle NVNT n20 5180MHz Ant3

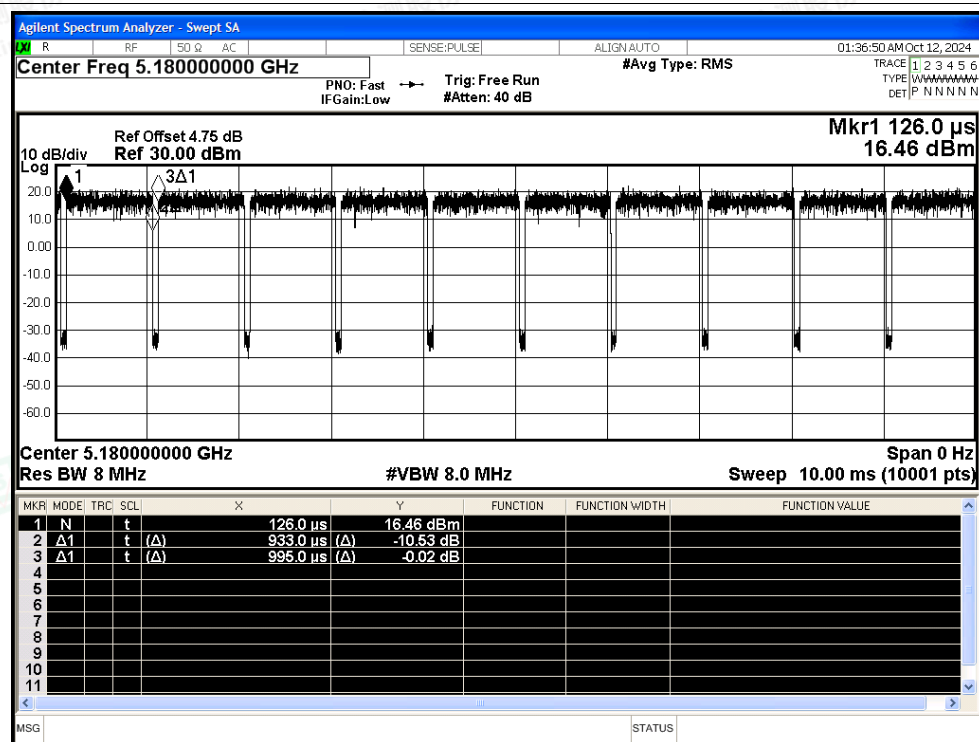




Duty Cycle NVNT n20 5200MHz Ant3

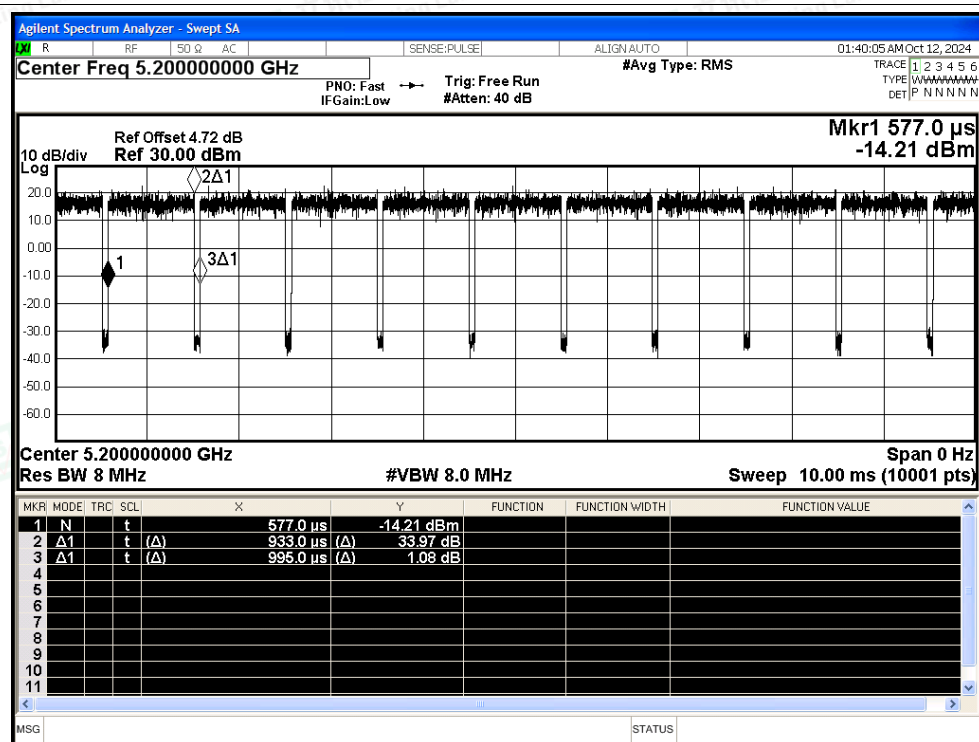


Duty Cycle NVNT n20 5240MHz Ant3

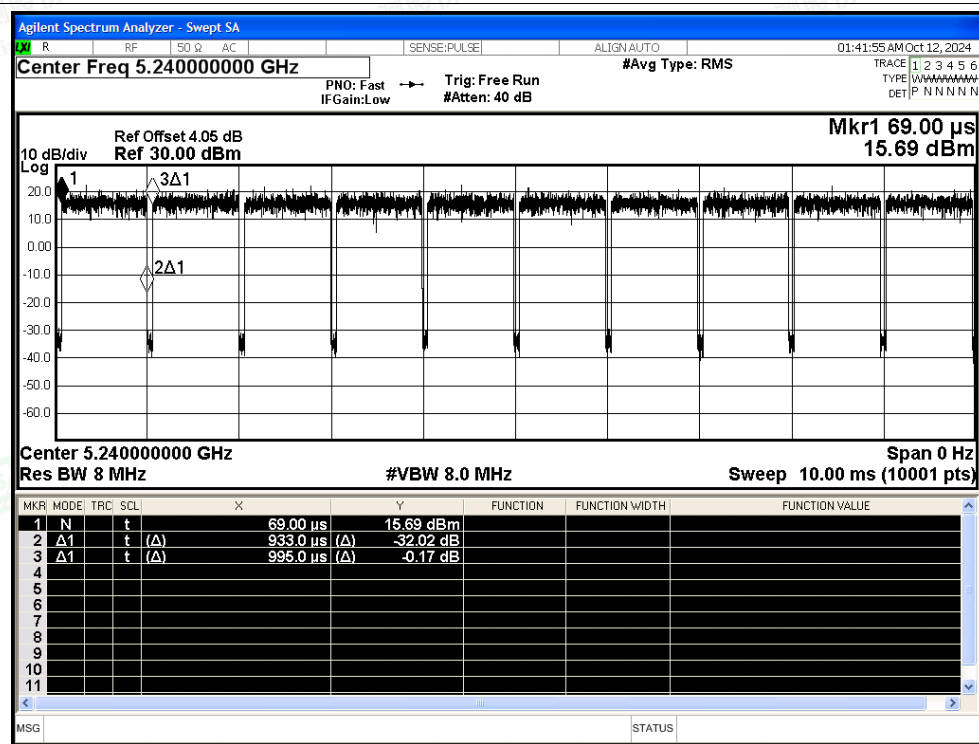




Duty Cycle NVNT n40 5190MHz Ant3

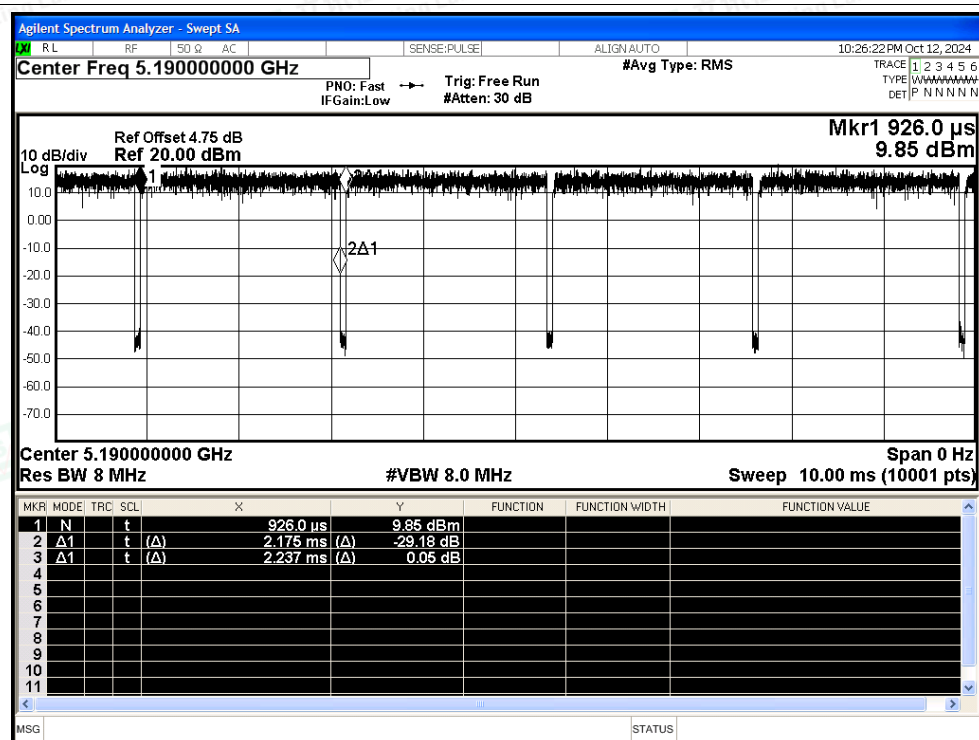


Duty Cycle NVNT n40 5230MHz Ant3

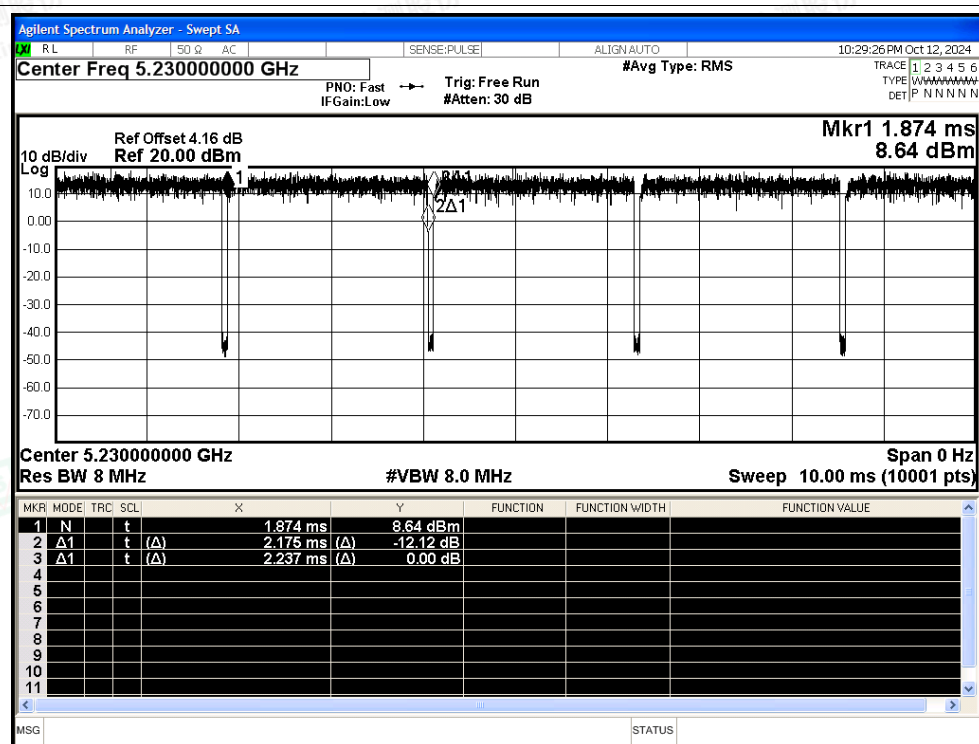




Duty Cycle NVNT ac20 5180MHz Ant3

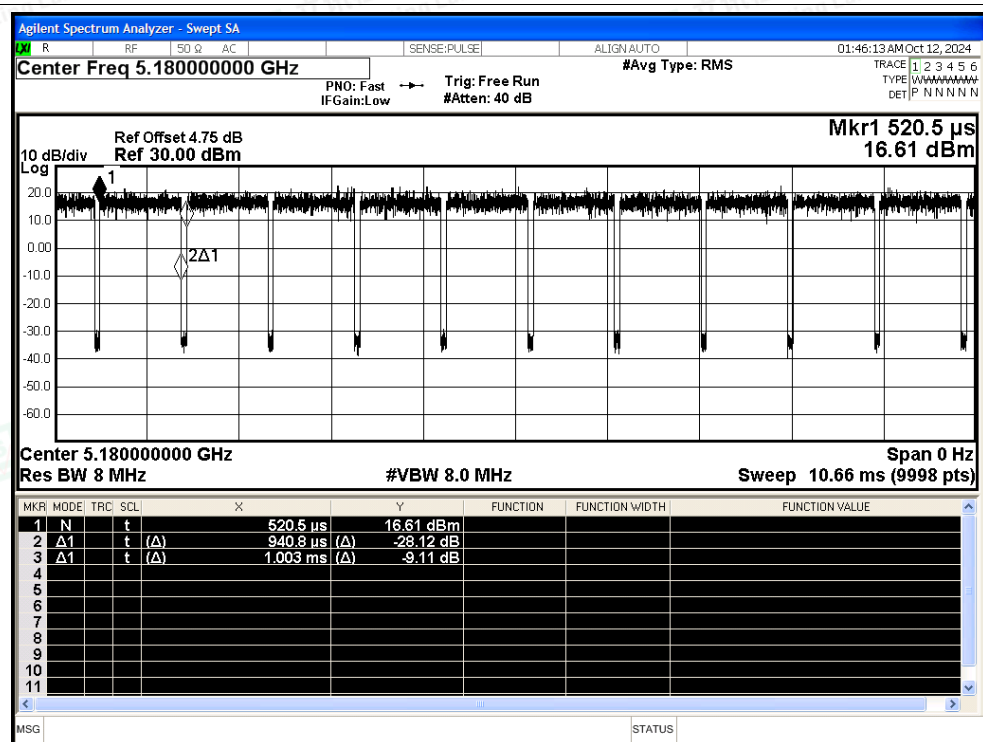


Duty Cycle NVNT ac20 5200MHz Ant3

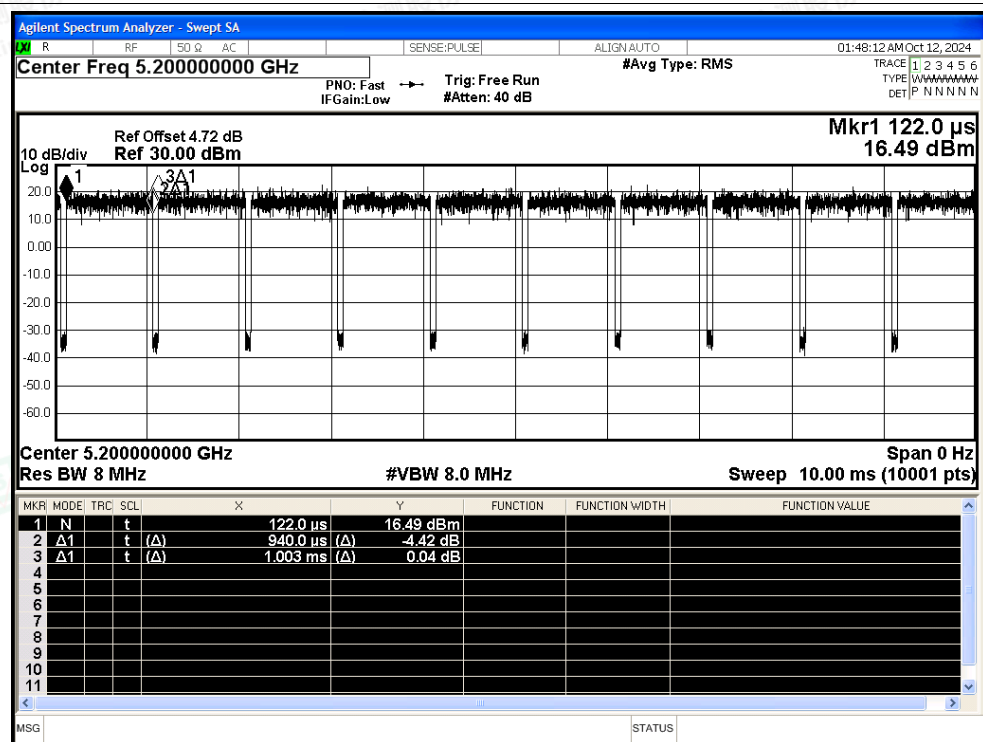




Duty Cycle NVNT ac20 5240MHz Ant3

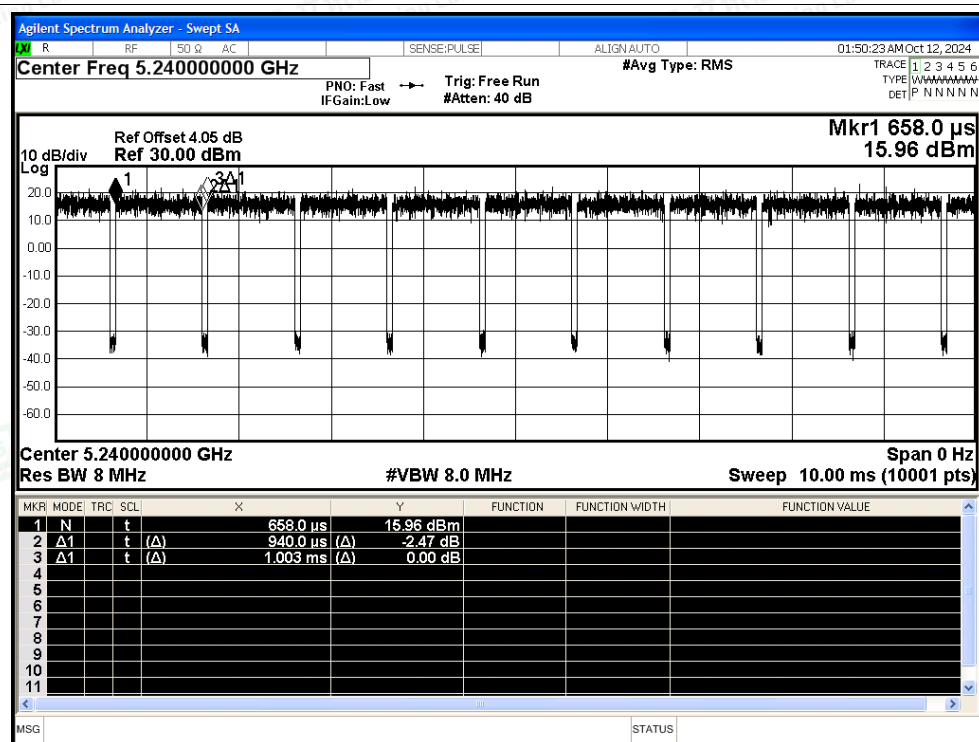


Duty Cycle NVNT ac40 5190MHz Ant3

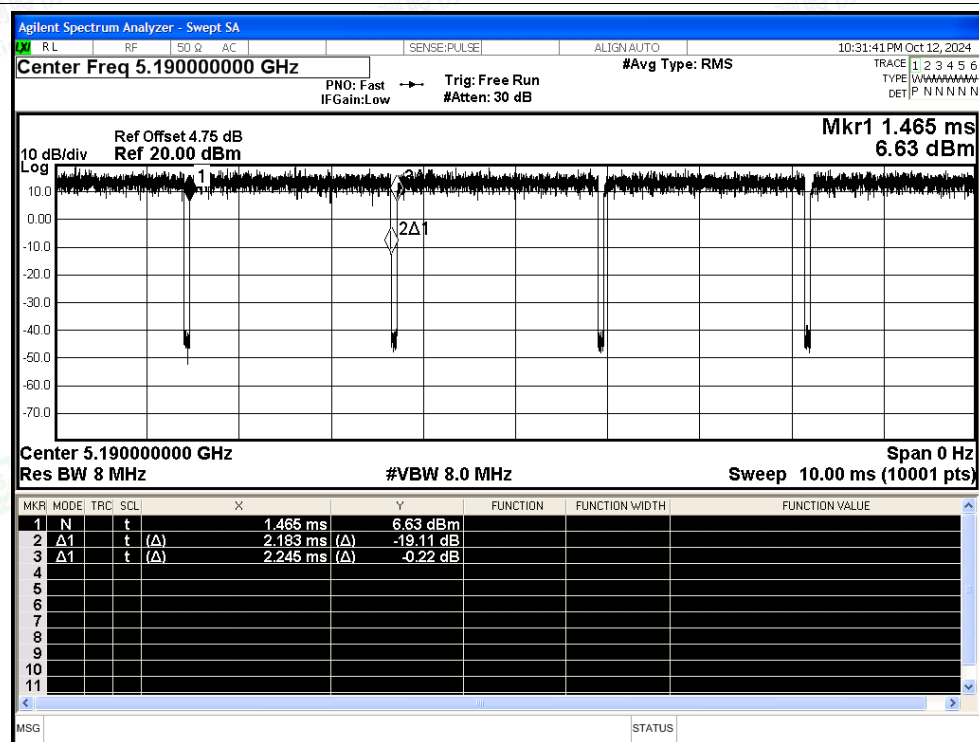




Duty Cycle NVNT ac40 5230MHz Ant3

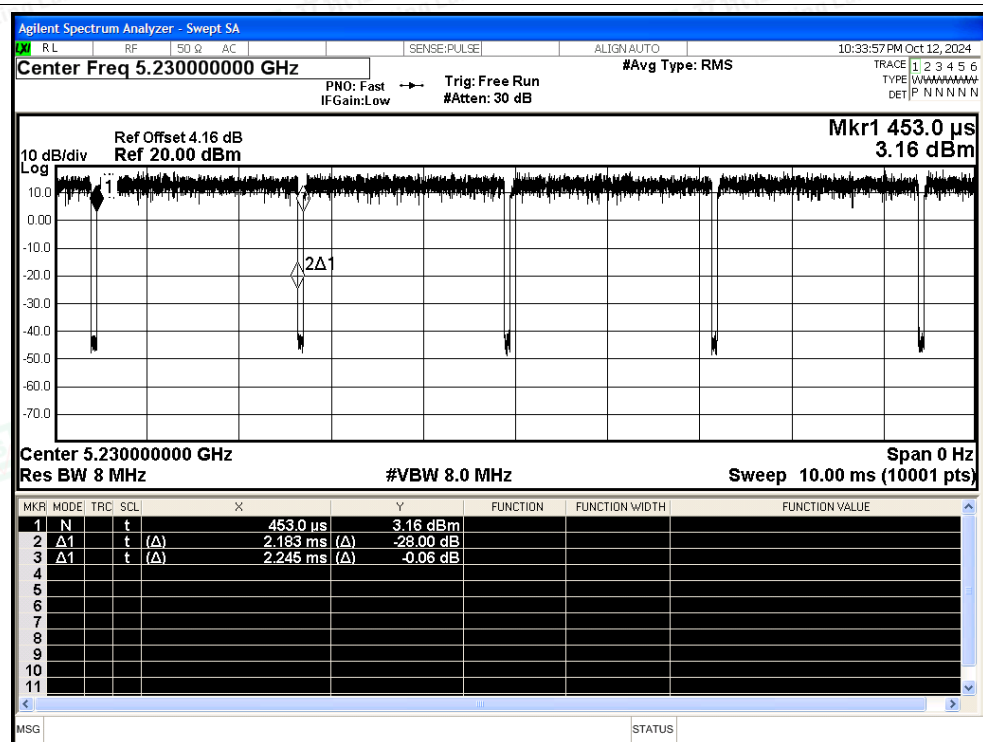


Duty Cycle NVNT ac80 5210MHz Ant3

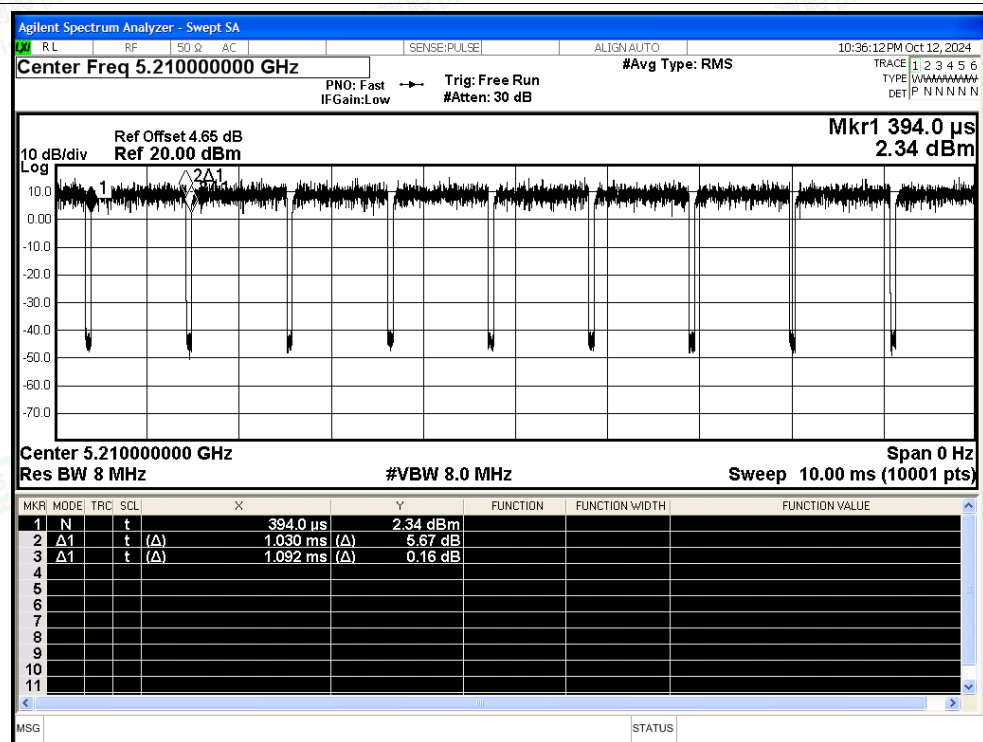




Test Graphs

Duty Cycle NVNT ax20 5180MHz Ant3

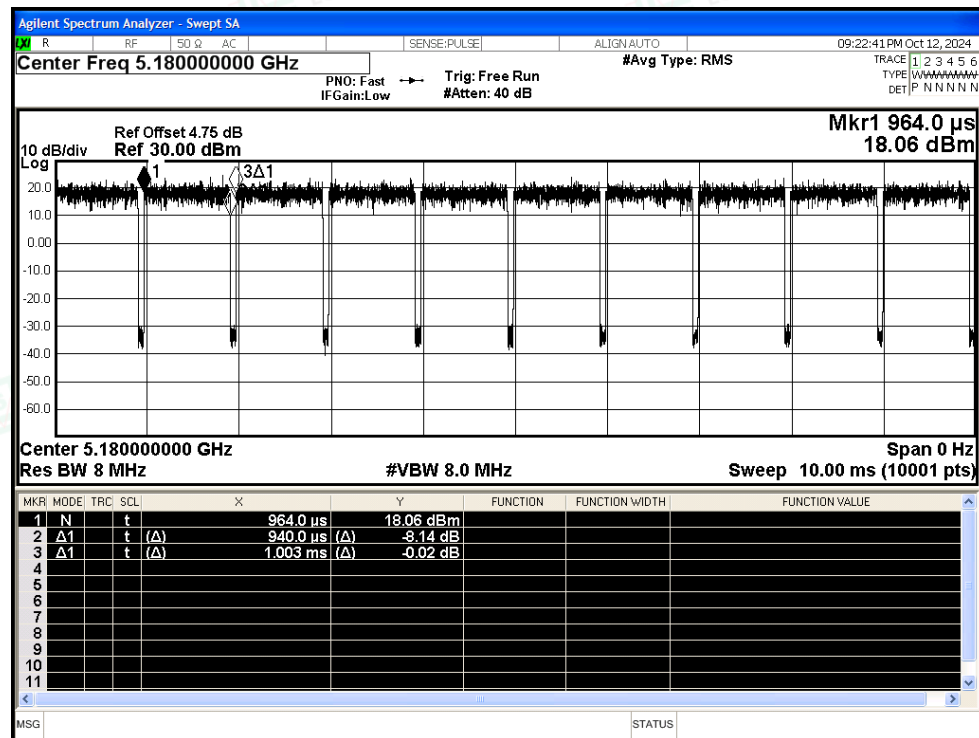


Duty Cycle NVNT ax20 5200MHz Ant3

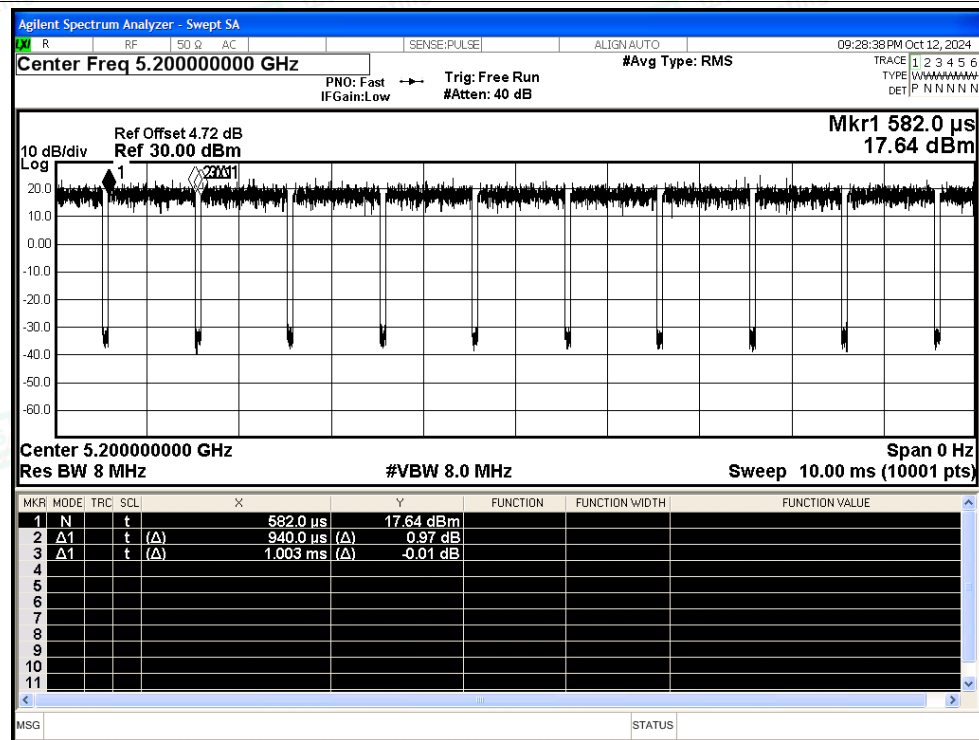




Duty Cycle NVNT ax20 5240MHz Ant3

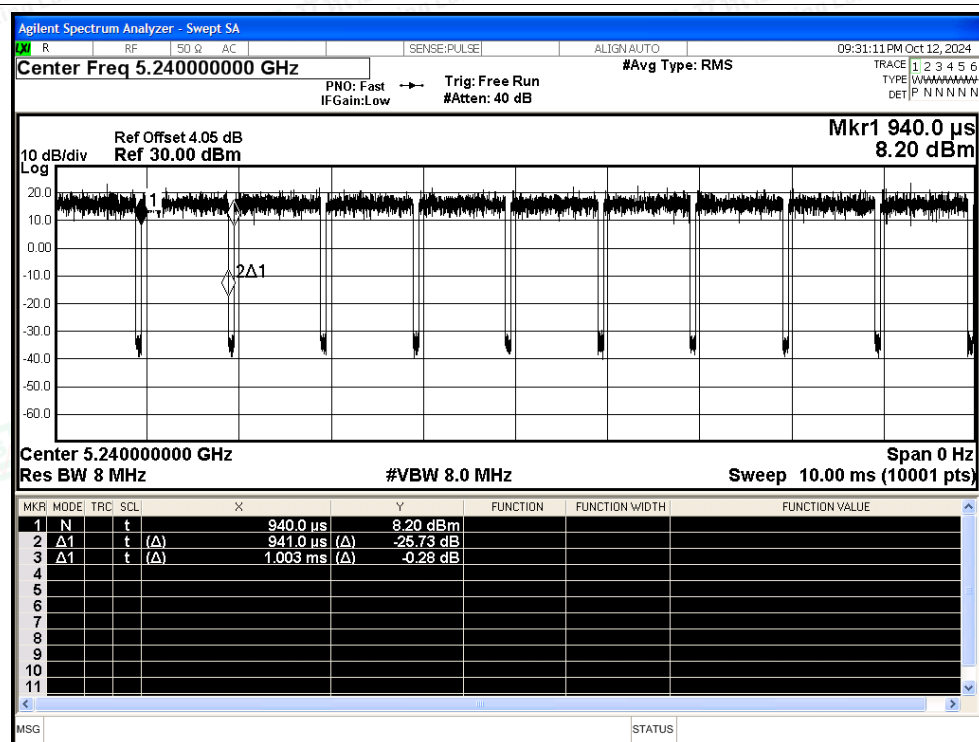

Duty Cycle NVNT ax40 5190MHz Ant3

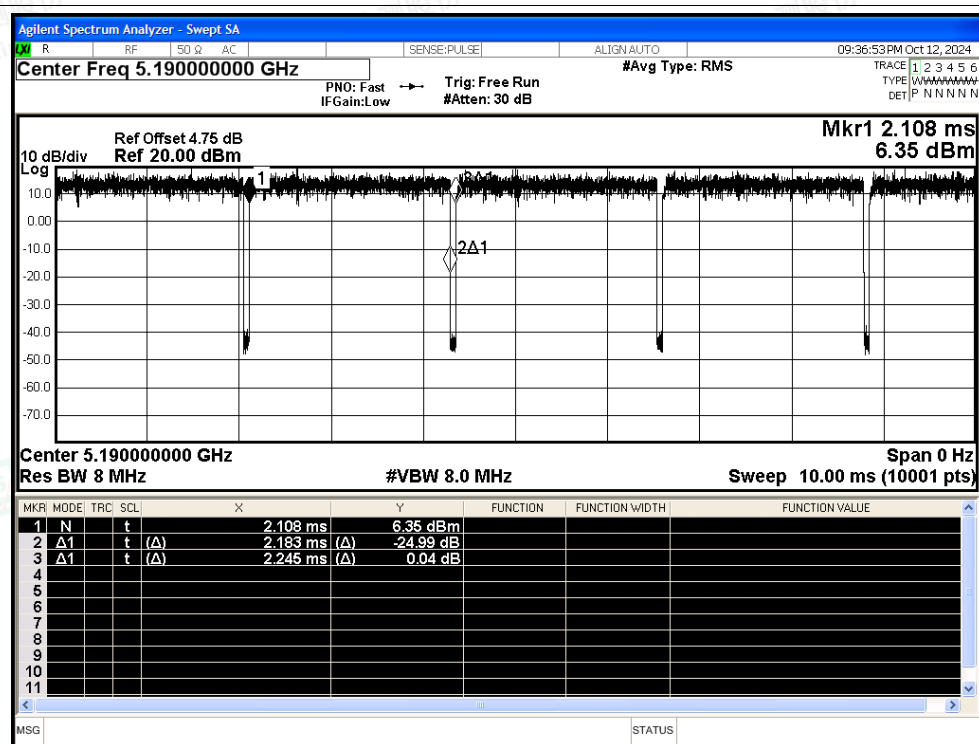




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant4	94.65	0.24	0.91
NVNT	a	5200	Ant4	94.65	0.24	0.91
NVNT	a	5240	Ant4	94.56	0.24	0.91
NVNT	n20	5180	Ant4	93.77	0.28	1.07
NVNT	n20	5200	Ant4	93.77	0.28	1.07
NVNT	n20	5240	Ant4	93.77	0.28	1.07
NVNT	n40	5190	Ant4	97.23	0.12	0.46
NVNT	n40	5230	Ant4	97.23	0.12	0.46
NVNT	ac20	5180	Ant4	93.73	0.28	1.06
NVNT	ac20	5200	Ant4	93.72	0.28	1.06
NVNT	ac20	5240	Ant4	93.82	0.28	1.06
NVNT	ac40	5190	Ant4	97.19	0.12	0.46
NVNT	ac40	5230	Ant4	97.24	0.12	0.46
NVNT	ac80	5210	Ant4	94.32	0.25	0.97
NVNT	ax20	5180	Ant4	93.72	0.28	1.06
NVNT	ax20	5200	Ant4	93.82	0.28	1.06
NVNT	ax20	5240	Ant4	93.72	0.28	1.06
NVNT	ax40	5190	Ant4	97.19	0.12	0.46
NVNT	ax40	5230	Ant4	97.24	0.12	0.46
NVNT	ax80	5210	Ant4	94.32	0.25	0.97






Test Graphs

Duty Cycle NVNT a 5180MHz Ant4

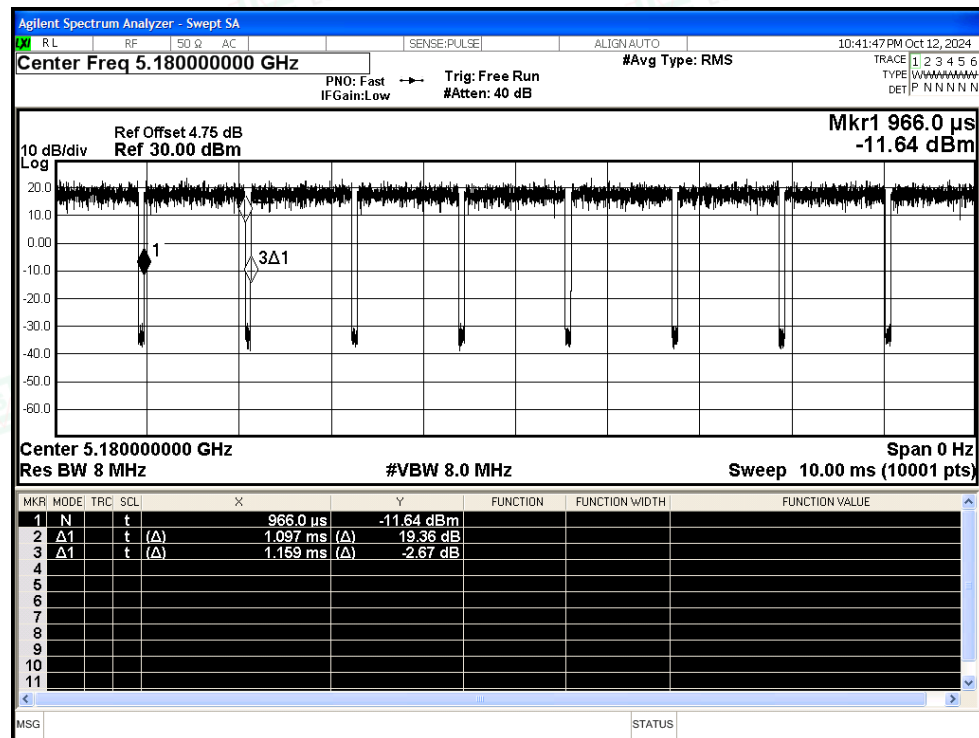

Duty Cycle NVNT a 5200MHz Ant4

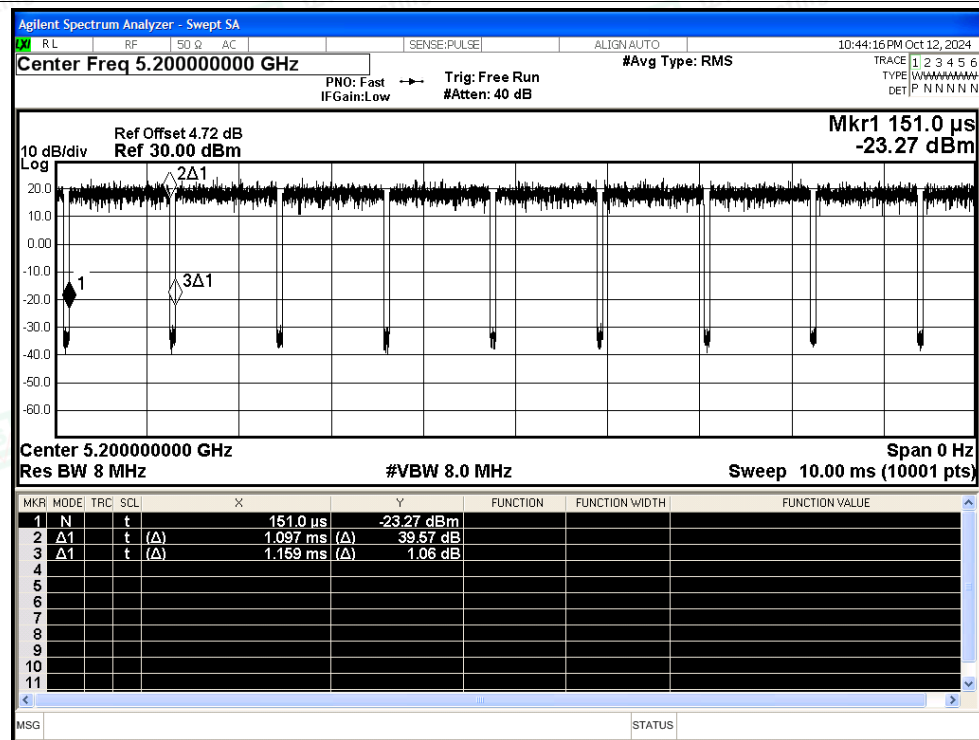

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant4

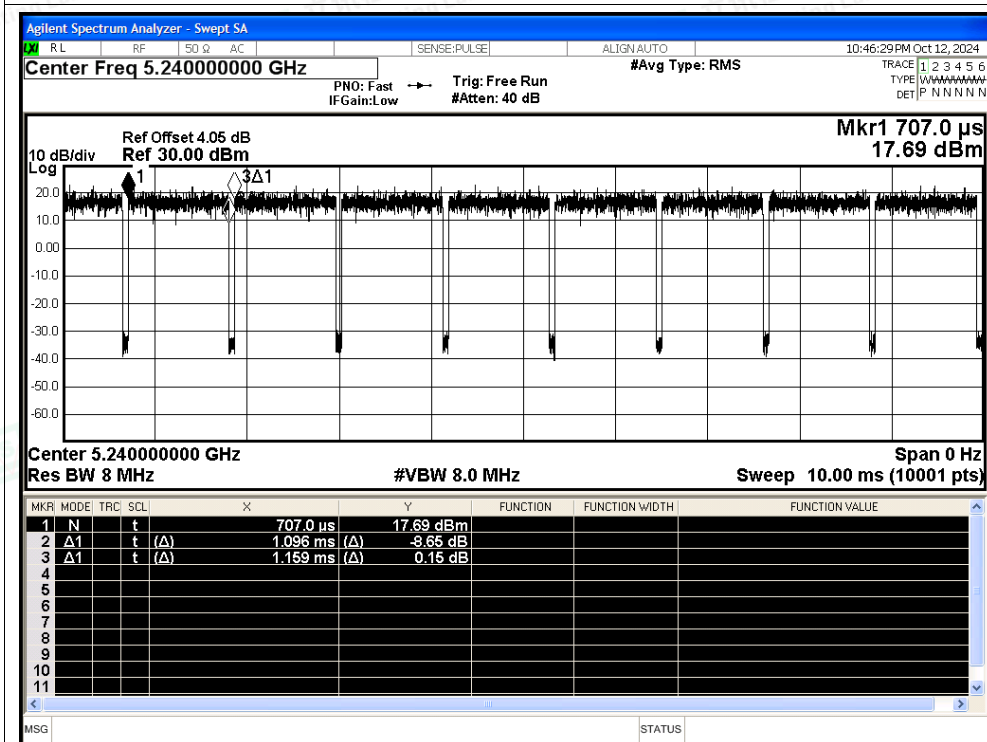

Duty Cycle NVNT n20 5180MHz Ant4

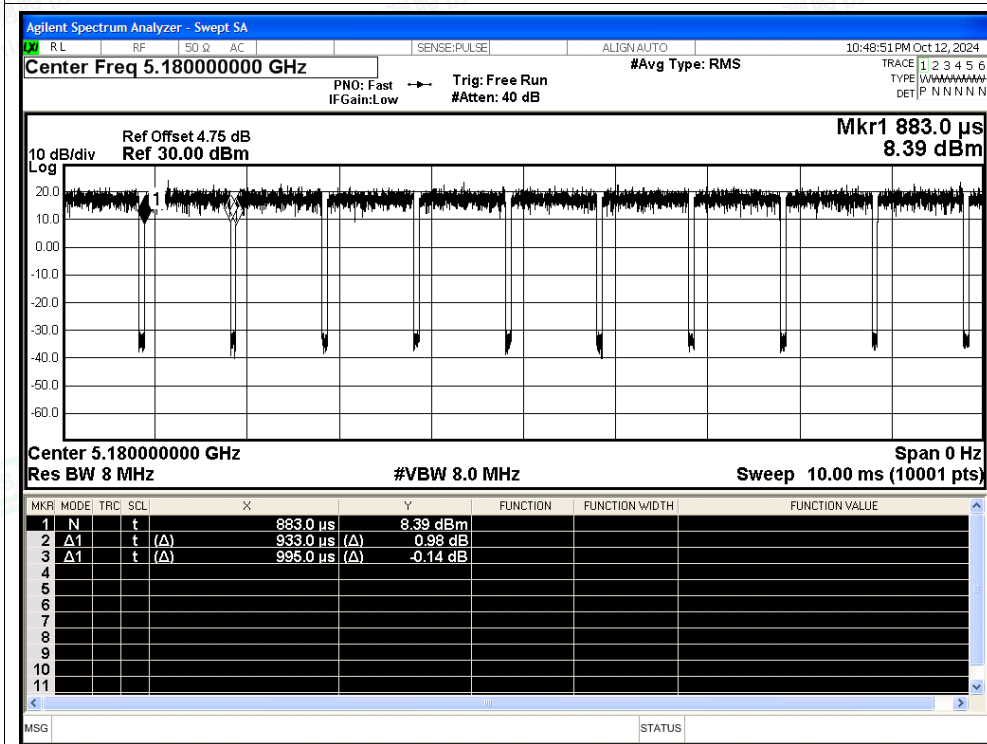

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant4

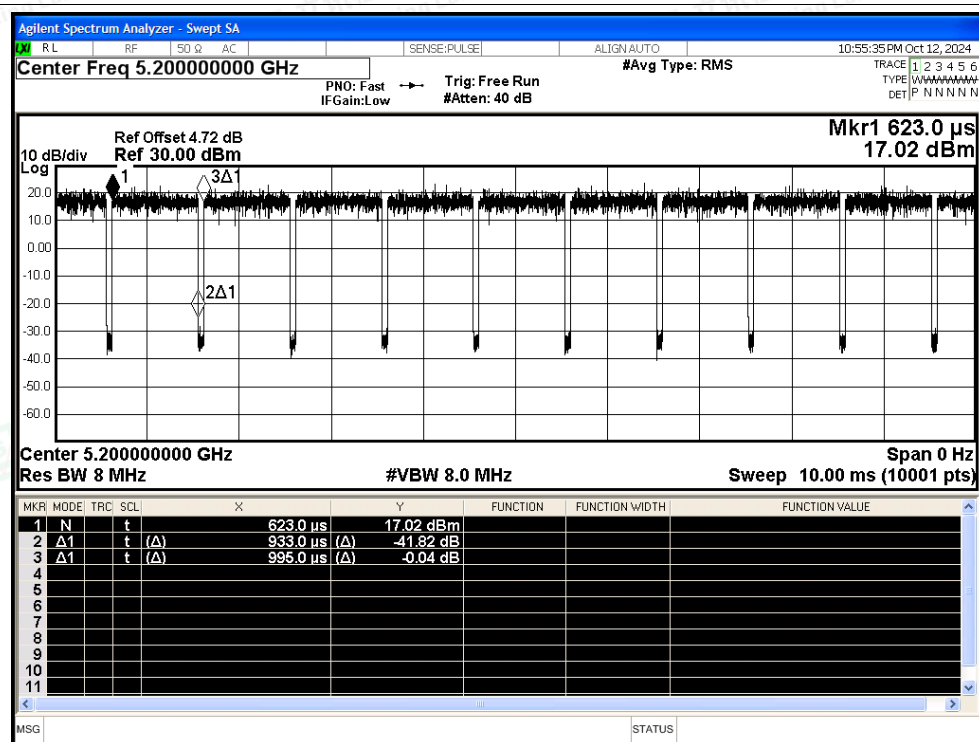


Duty Cycle NVNT n20 5240MHz Ant4

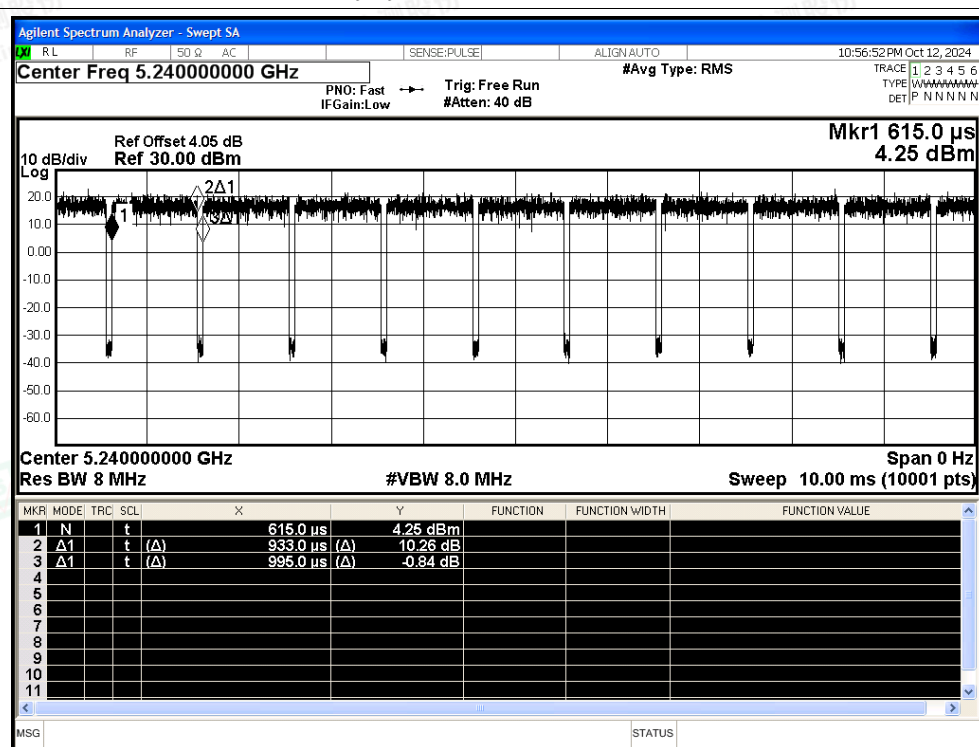




Duty Cycle NVNT n40 5190MHz Ant4

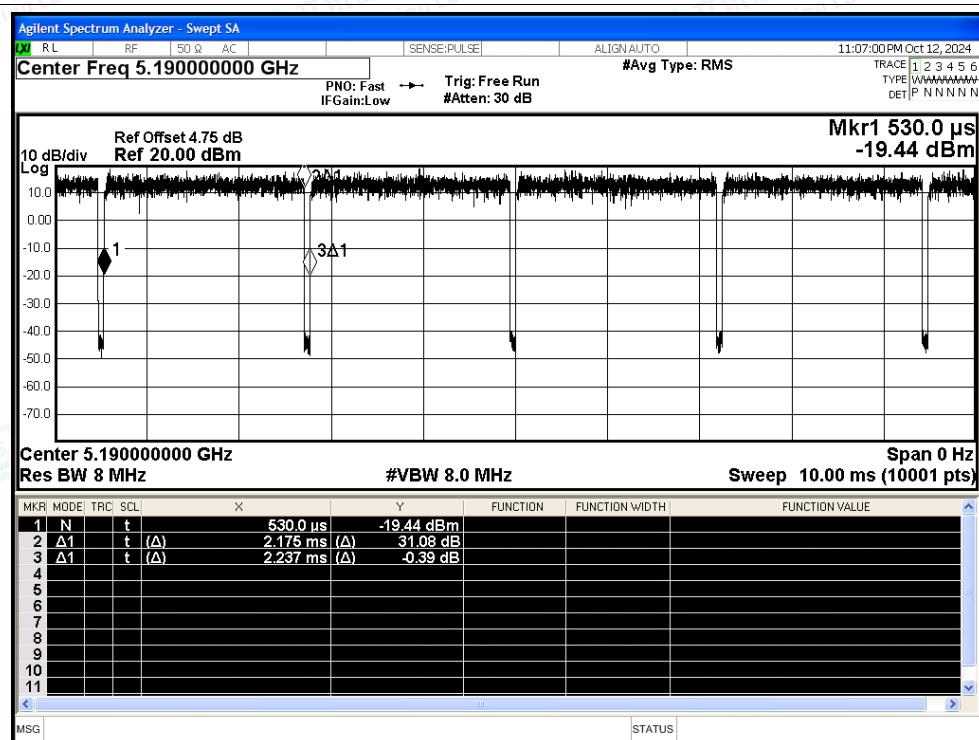


Duty Cycle NVNT n40 5230MHz Ant4

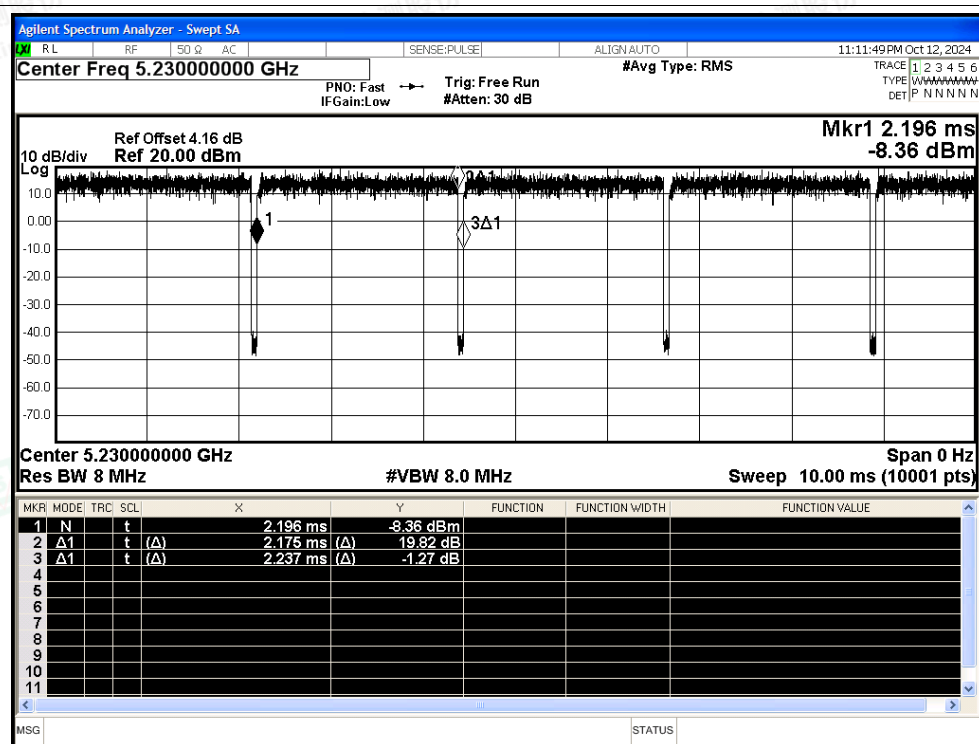




Duty Cycle NVNT ac20 5180MHz Ant4

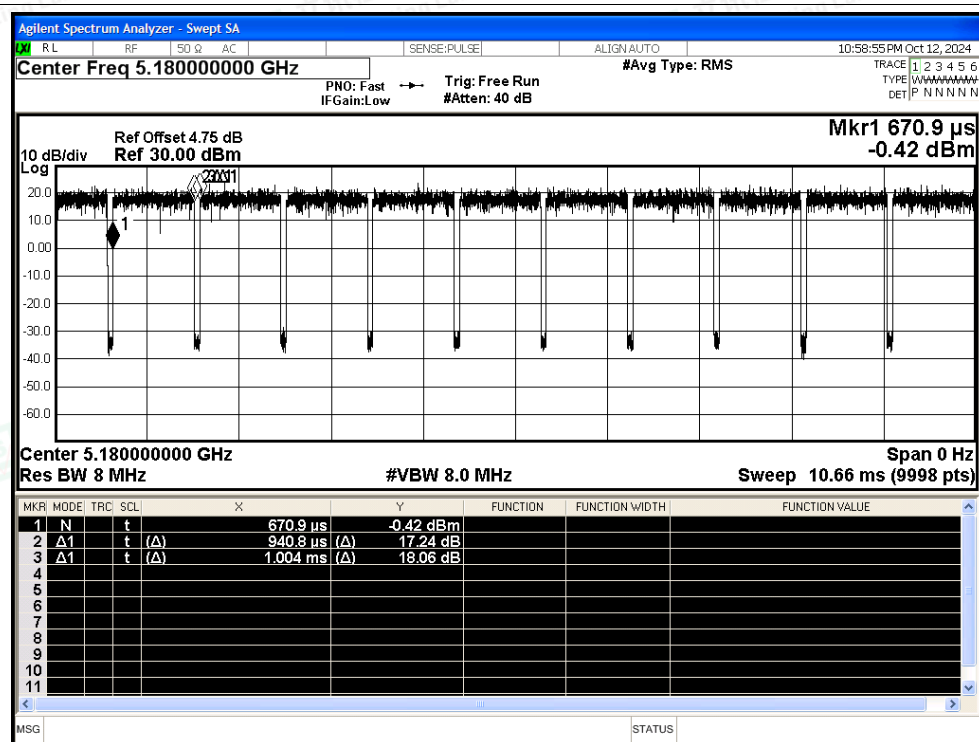


Duty Cycle NVNT ac20 5200MHz Ant4

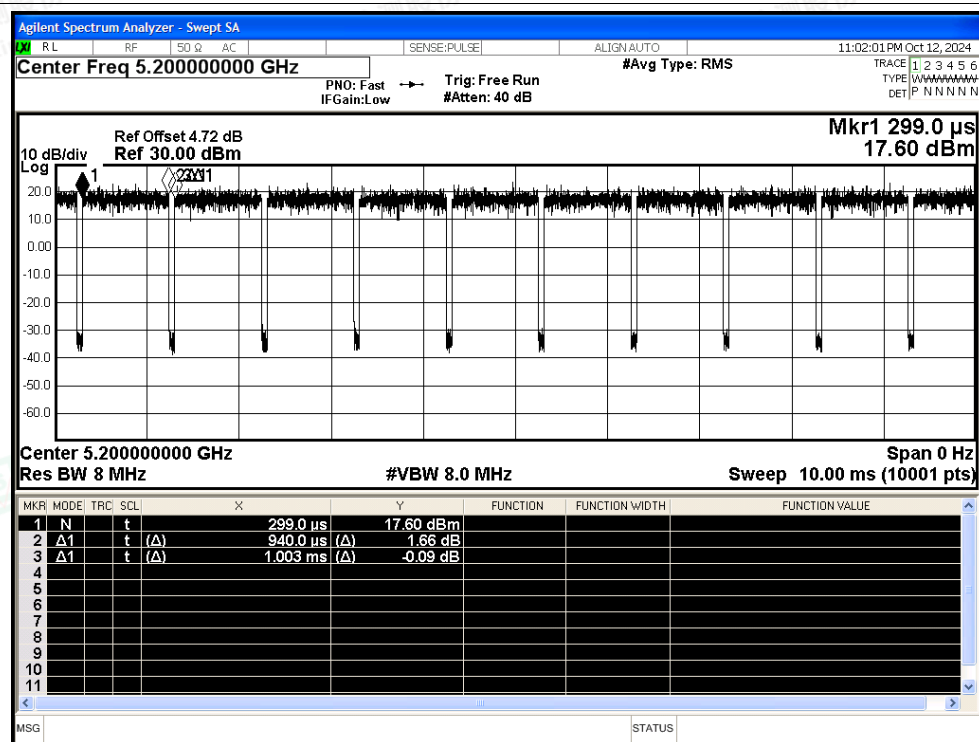




Duty Cycle NVNT ac20 5240MHz Ant4

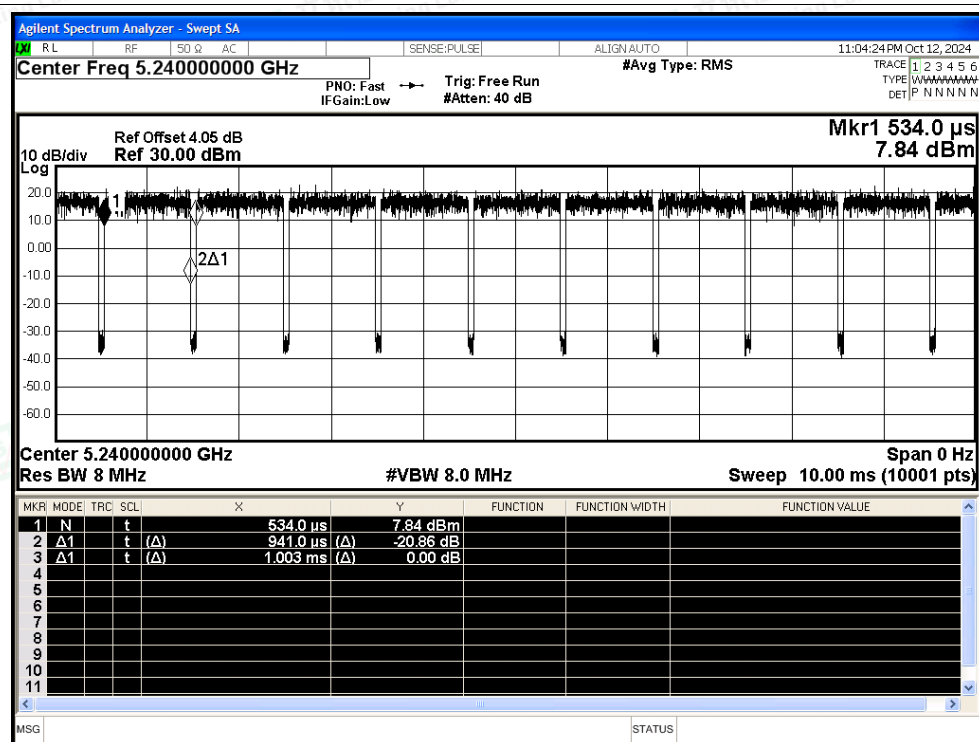


Duty Cycle NVNT ac40 5190MHz Ant4

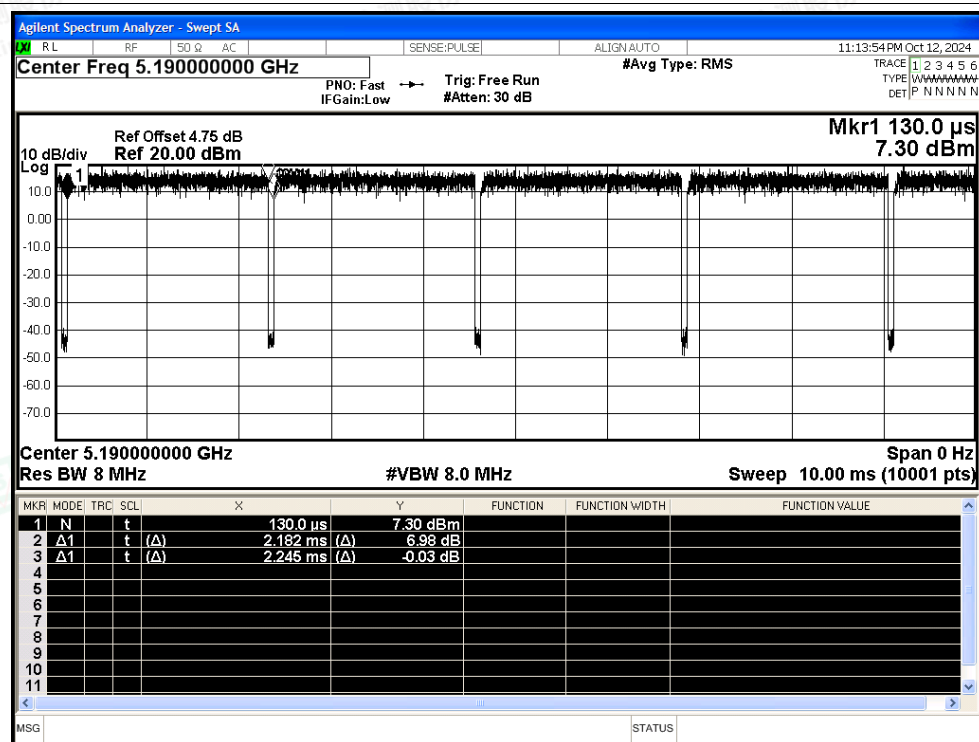




Duty Cycle NVNT ac40 5230MHz Ant4

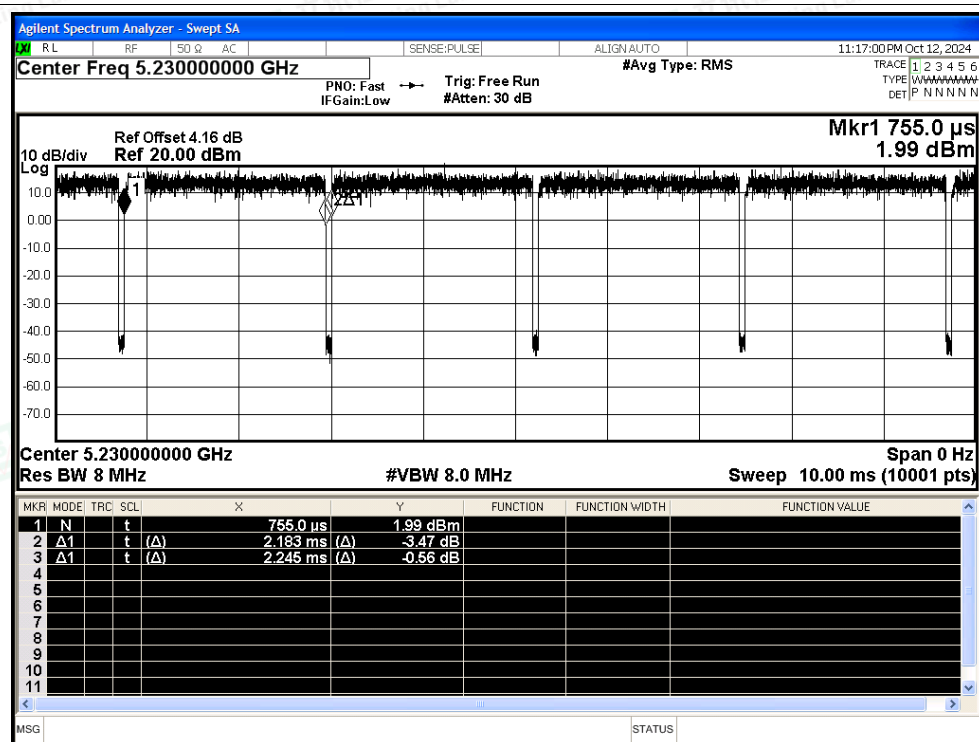


Duty Cycle NVNT ac80 5210MHz Ant4

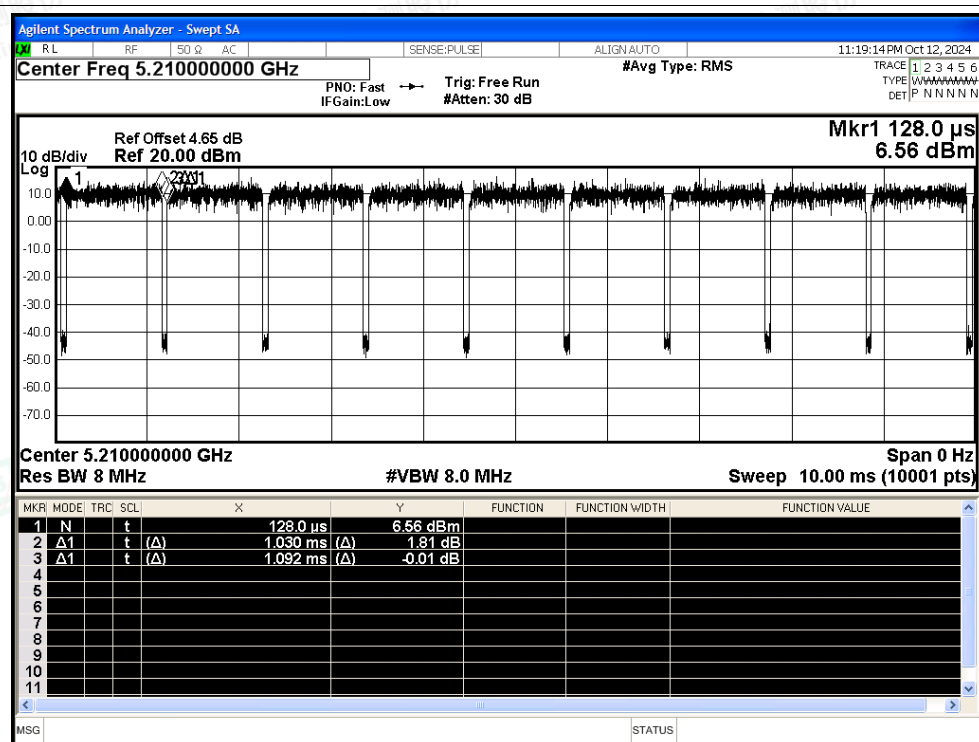


Duty Cycle NVNT ax20 5180MHz Ant4



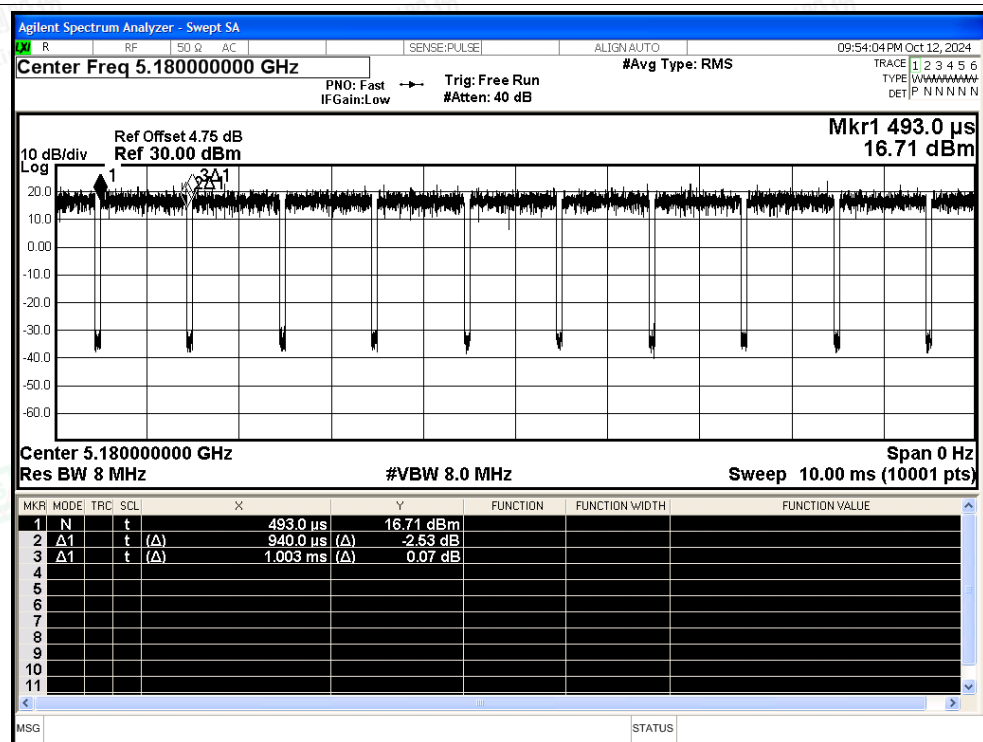


Duty Cycle NVNT ax20 5200MHz Ant4

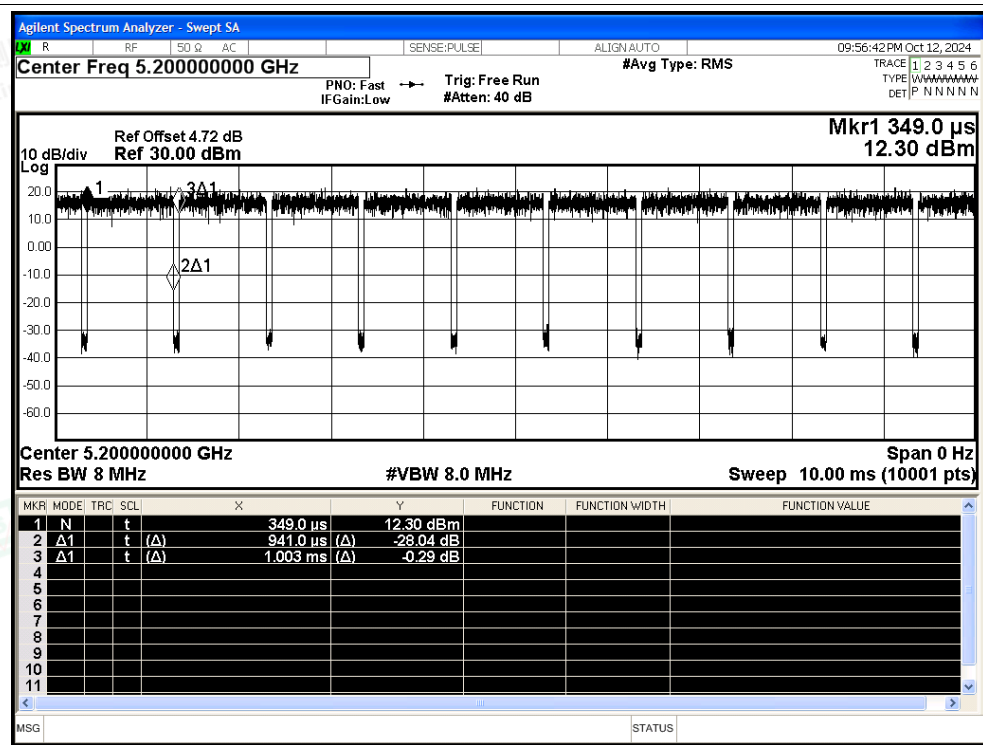




Duty Cycle NVNT ax20 5240MHz Ant4

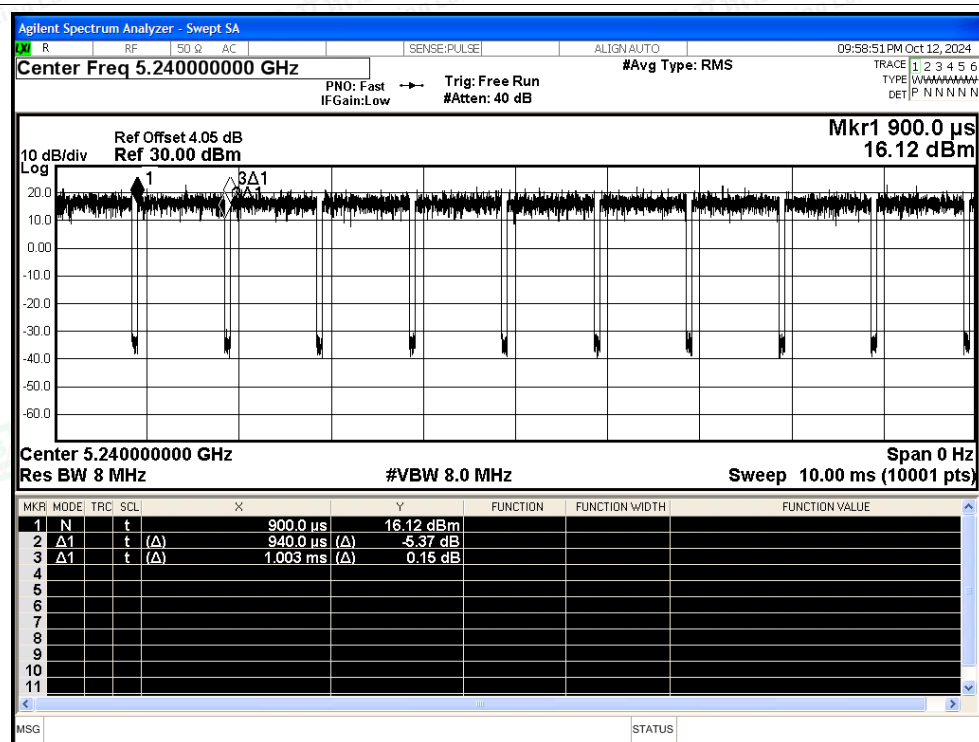


Duty Cycle NVNT ax40 5190MHz Ant4

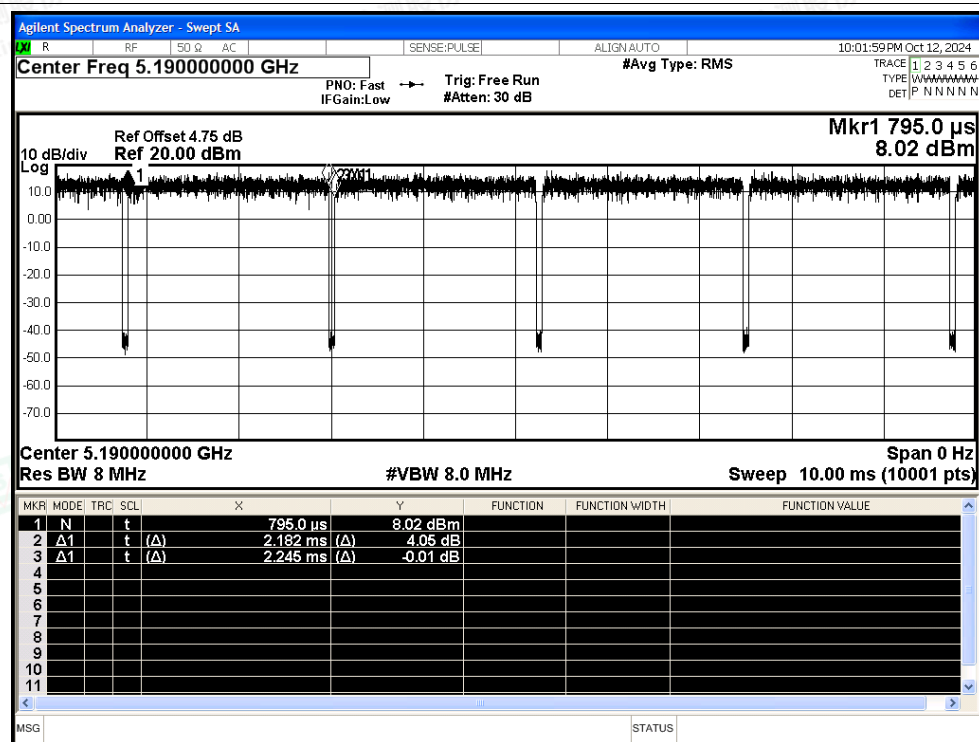



Duty Cycle NVNT ax40 5230MHz Ant4

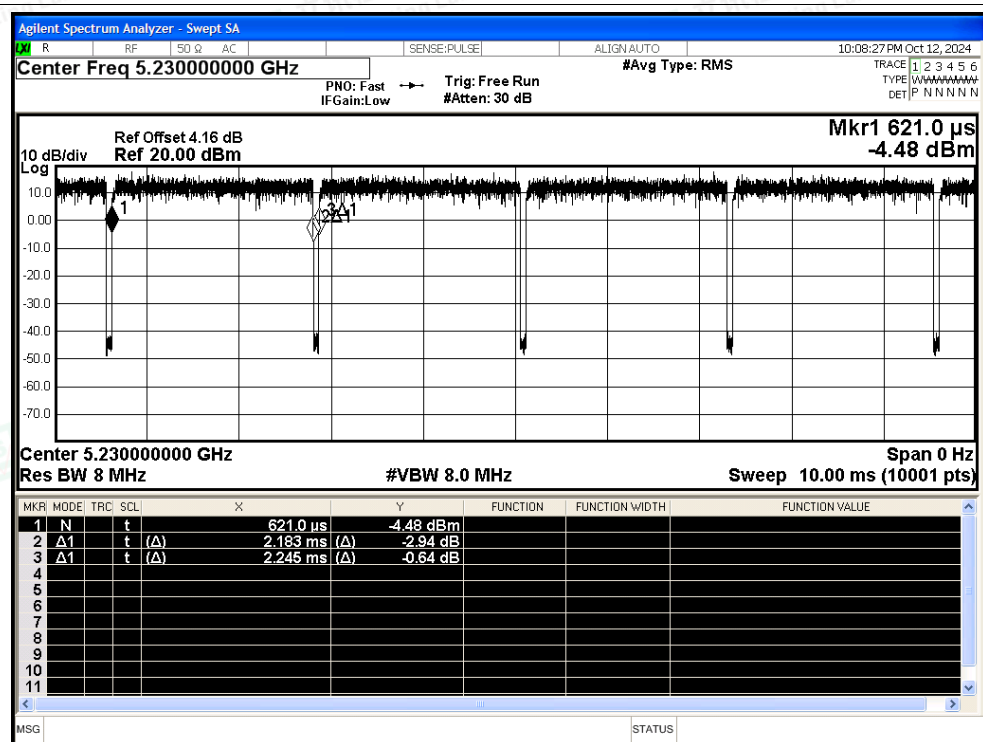

Duty Cycle NVNT ax80 5210MHz Ant4

