




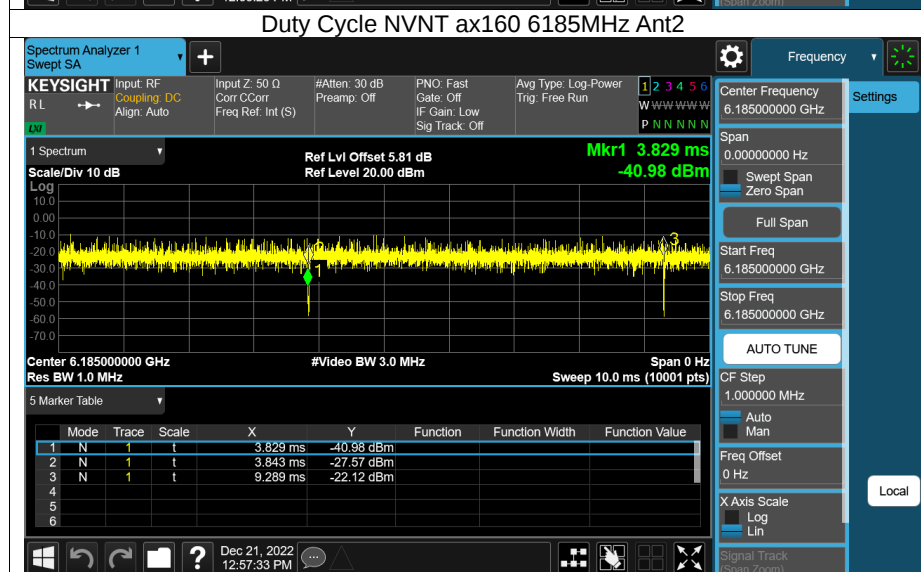
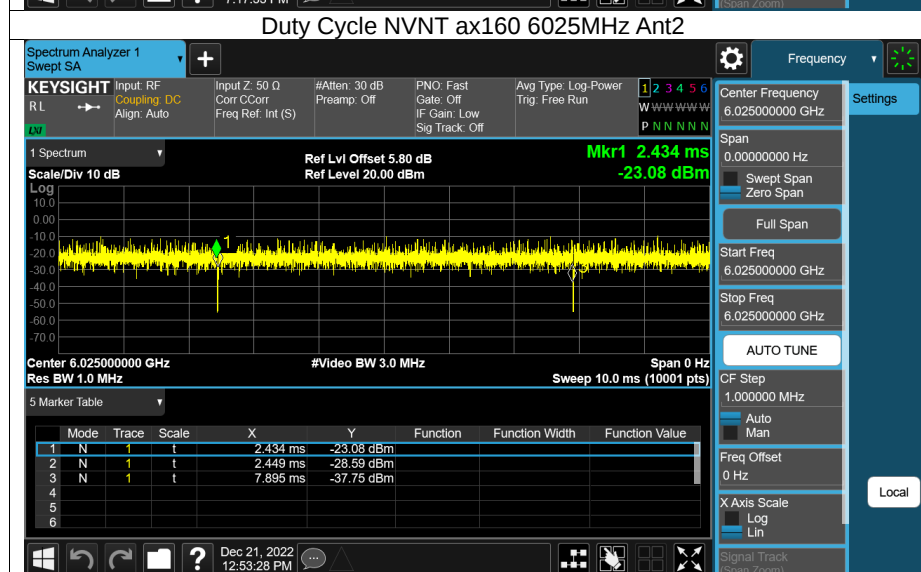


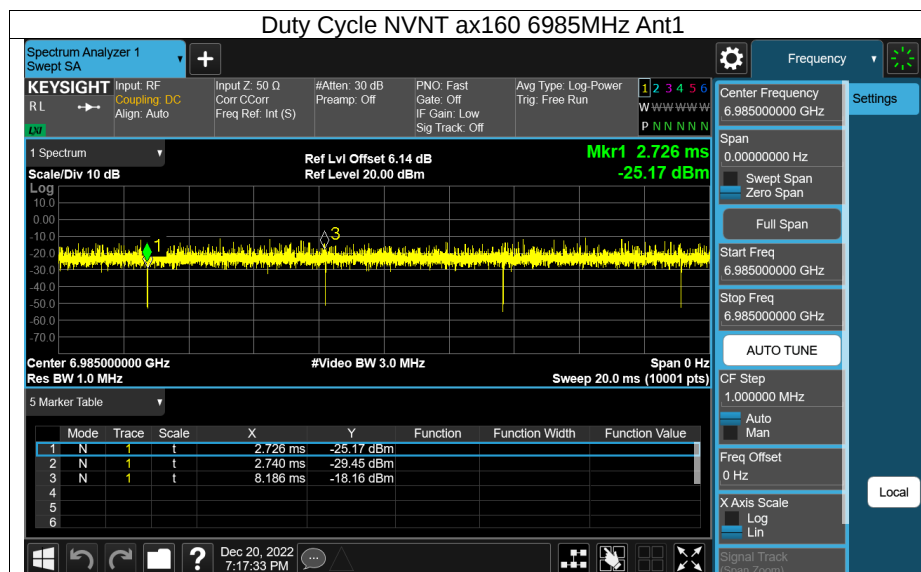

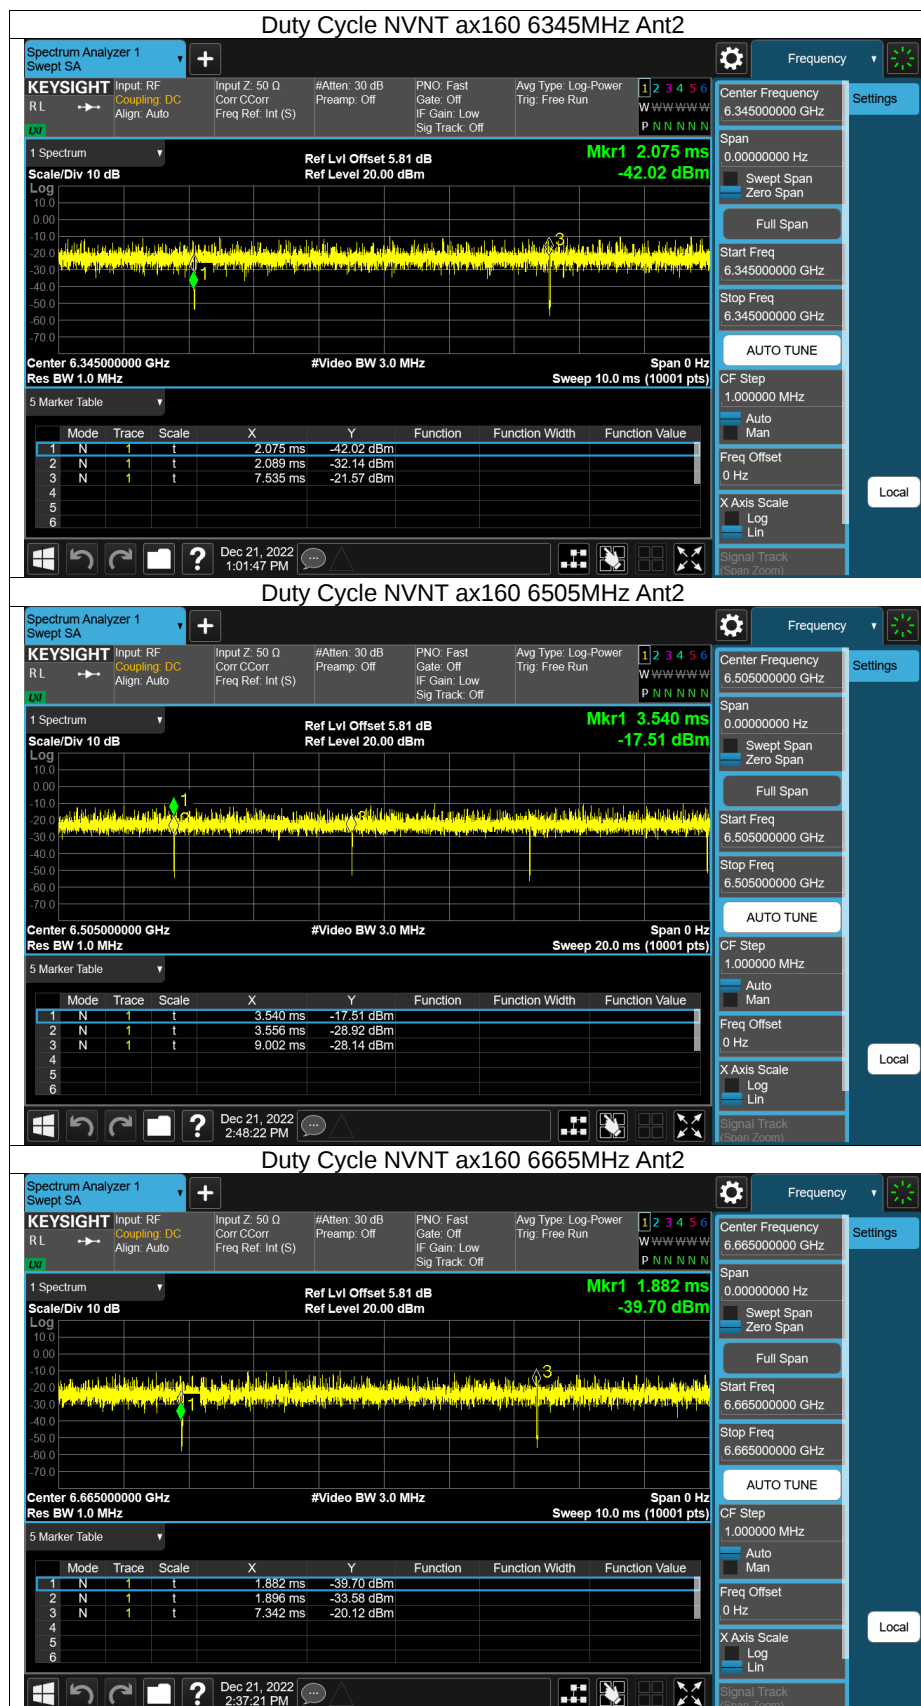

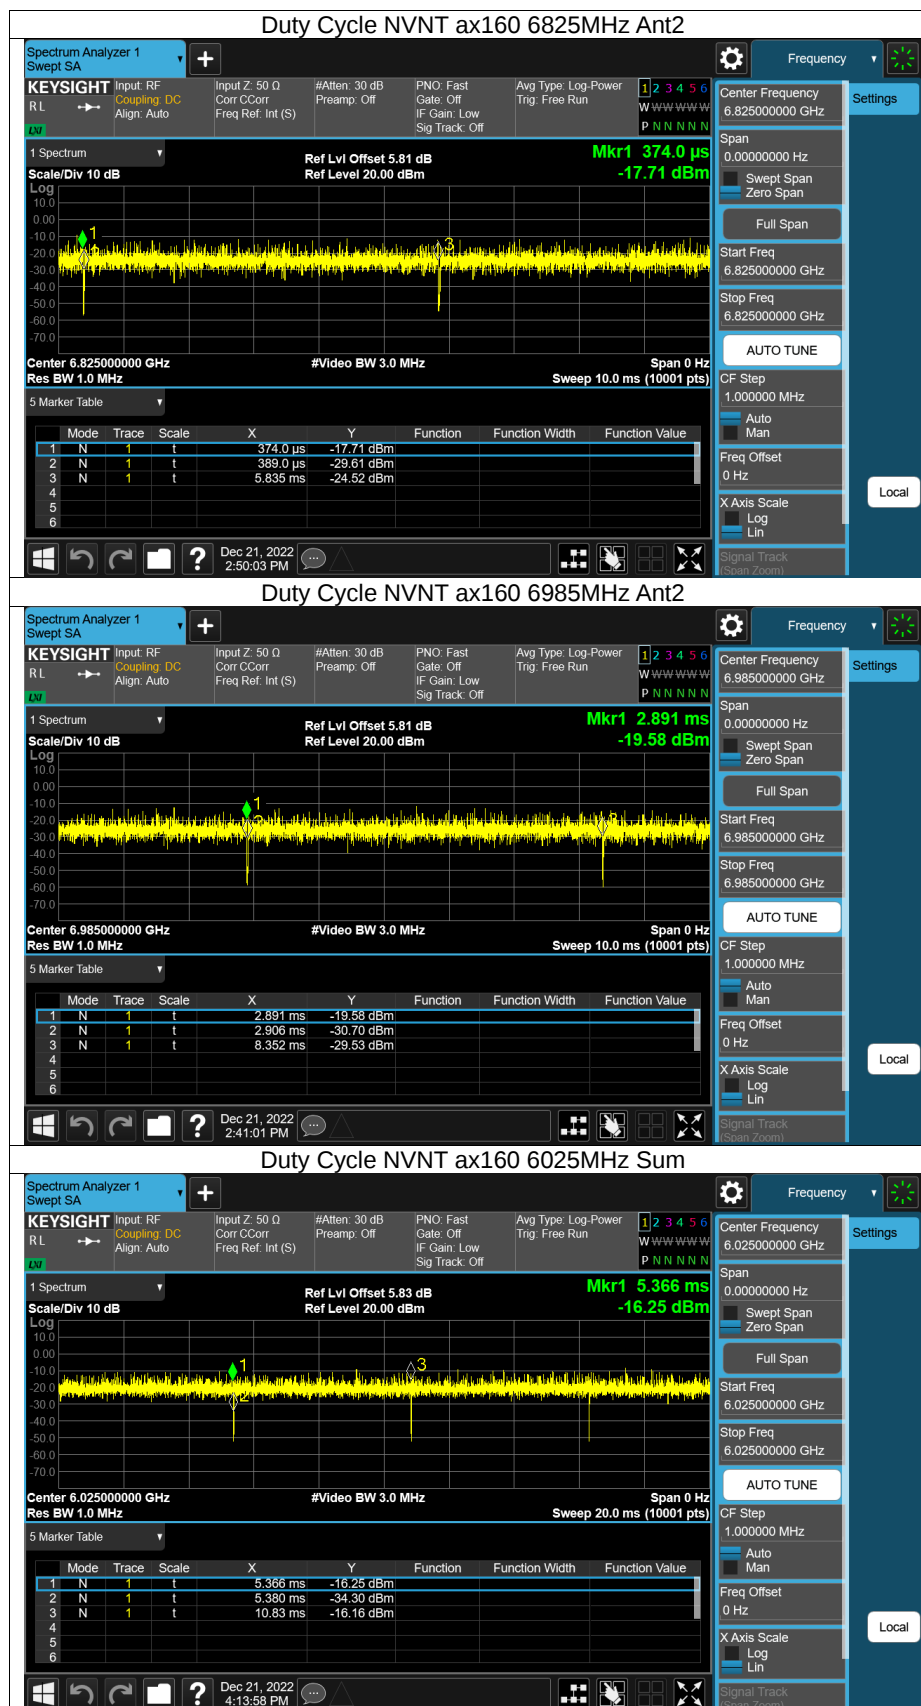

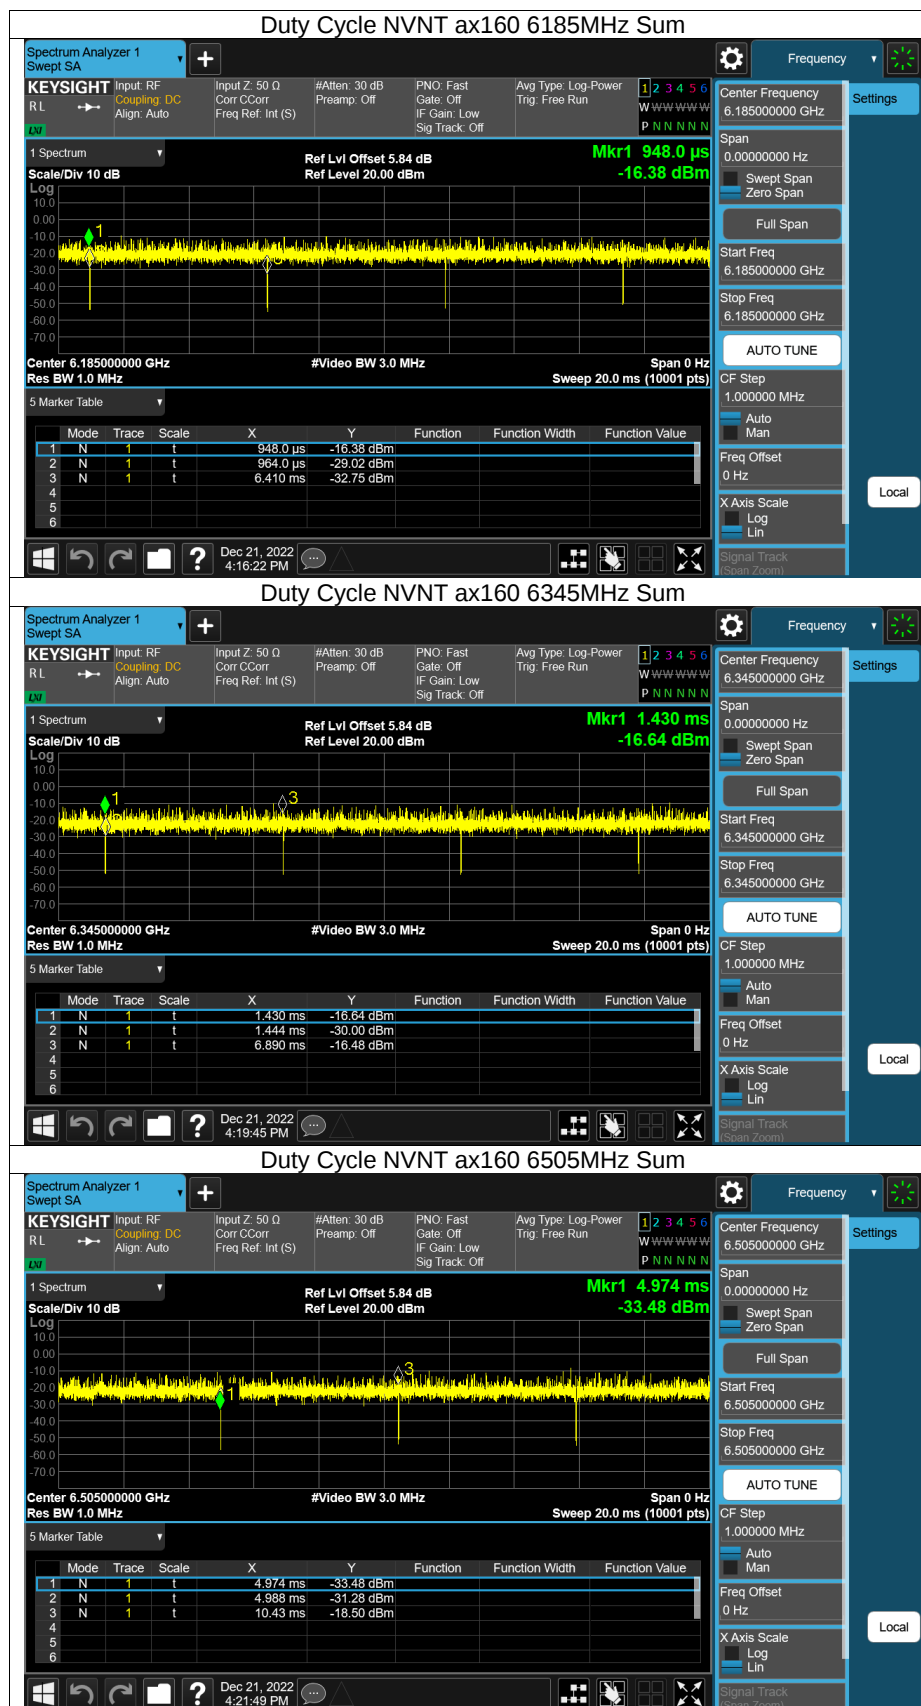

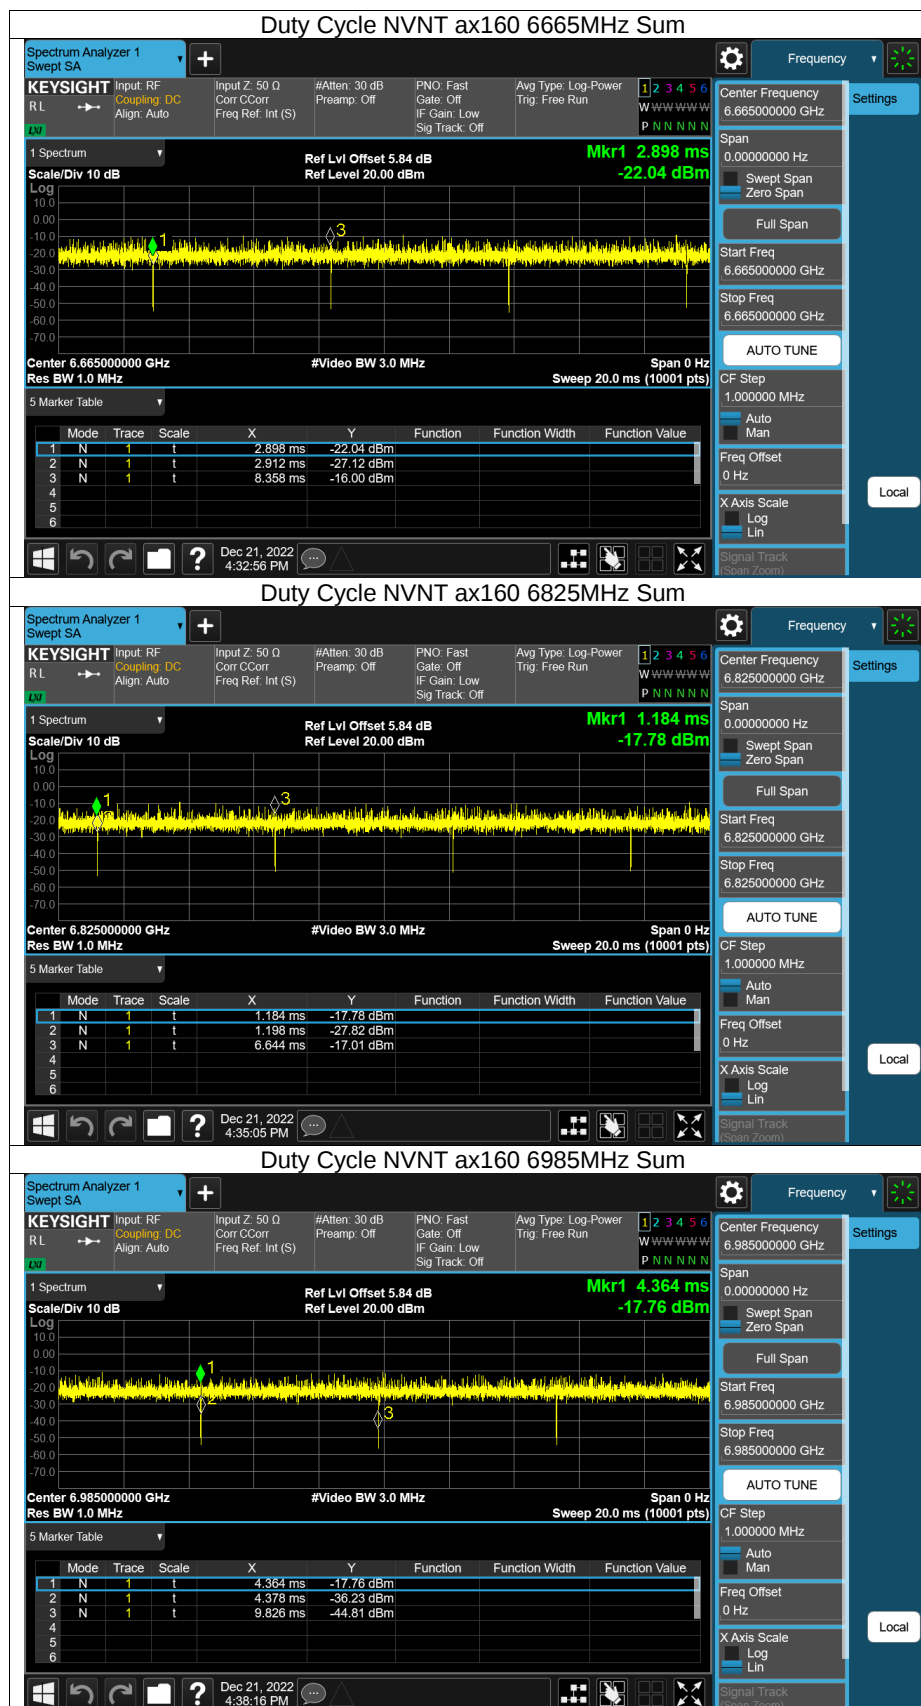



MAXIMUM CONDUCTED OUTPUT POWER

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Gain (dBi)	eirp Power	Limit (dBm)	Verdict
NVNT	a	5955	Ant1	5.85	0	5.85	4.18	10.03	24	Pass
NVNT	a	6175	Ant1	7.11	0	7.11	4.18	11.29	24	Pass
NVNT	a	6415	Ant1	7.03	0	7.03	4.18	11.21	24	Pass
NVNT	a	6435	Ant1	5.86	0	5.86	4.18	10.04	24	Pass
NVNT	a	6475	Ant1	5.72	0	5.72	4.18	9.9	24	Pass
NVNT	a	6515	Ant1	4.48	0	4.48	4.18	8.66	24	Pass
NVNT	a	6535	Ant1	4.72	0	4.72	4.18	8.9	24	Pass
NVNT	a	6695	Ant1	5.79	0	5.79	4.18	9.97	24	Pass
NVNT	a	6855	Ant1	5.91	0	5.91	4.18	10.09	24	Pass
NVNT	a	6895	Ant1	5.6	0	5.6	4.18	9.78	24	Pass
NVNT	a	7115	Ant1	5.97	0	5.97	4.18	10.15	24	Pass
NVNT	a	5955	Ant2	7.42	0	7.42	4.18	11.6	24	Pass
NVNT	a	6175	Ant2	6.64	0	6.64	4.18	10.82	24	Pass
NVNT	a	6415	Ant2	6.77	0	6.77	4.18	10.95	24	Pass
NVNT	a	6435	Ant2	7.28	0	7.28	4.18	11.46	24	Pass
NVNT	a	6475	Ant2	7.41	0	7.41	4.18	11.59	24	Pass
NVNT	a	6515	Ant2	6.69	0	6.69	4.18	10.87	24	Pass
NVNT	a	6535	Ant2	6.52	0	6.52	4.18	10.7	24	Pass
NVNT	a	6695	Ant2	6.8	0	6.8	4.18	10.98	24	Pass
NVNT	a	6855	Ant2	5.73	0	5.73	4.18	9.91	24	Pass
NVNT	a	6895	Ant2	5.91	0	5.91	4.18	10.09	24	Pass
NVNT	a	7115	Ant2	5.87	0	5.87	4.18	10.05	24	Pass
NVNT	n20	5955	Ant1	4.69	0	4.69	4.18	8.87	24	Pass
NVNT	n20	6175	Ant1	5.41	0	5.41	4.18	9.59	24	Pass
NVNT	n20	6415	Ant1	6.75	0	6.75	4.18	10.93	24	Pass
NVNT	n20	6435	Ant1	7.04	0	7.04	4.18	11.22	24	Pass
NVNT	n20	6475	Ant1	6.83	0	6.83	4.18	11.01	24	Pass
NVNT	n20	6515	Ant1	5.77	0	5.77	4.18	9.95	24	Pass
NVNT	n20	6535	Ant1	5.59	0	5.59	4.18	9.77	24	Pass
NVNT	n20	6695	Ant1	6.38	0	6.38	4.18	10.56	24	Pass
NVNT	n20	6855	Ant1	5.63	0	5.63	4.18	9.81	24	Pass
NVNT	n20	6895	Ant1	5.37	0	5.37	4.18	9.55	24	Pass
NVNT	n20	7115	Ant1	5.84	0	5.84	4.18	10.02	24	Pass
NVNT	n20	5955	Ant2	7.62	0	7.62	4.18	11.8	24	Pass
NVNT	n20	6175	Ant2	6.51	0	6.51	4.18	10.69	24	Pass
NVNT	n20	6415	Ant2	6.47	0	6.47	4.18	10.65	24	Pass
NVNT	n20	6435	Ant2	6.99	0	6.99	4.18	11.17	24	Pass
NVNT	n20	6475	Ant2	6.97	0	6.97	4.18	11.15	24	Pass
NVNT	n20	6515	Ant2	6.06	0	6.06	4.18	10.24	24	Pass
NVNT	n20	6535	Ant2	6.04	0	6.04	4.18	10.22	24	Pass
NVNT	n20	6695	Ant2	6.41	0	6.41	4.18	10.59	24	Pass
NVNT	n20	6855	Ant2	5.04	0	5.04	4.18	9.22	24	Pass
NVNT	n20	6895	Ant2	5.26	0	5.26	4.18	9.44	24	Pass



NVNT	n20	7115	Ant2	5.35	0	5.35	4.18	9.53	24	Pass
NVNT	n20	5955	Ant1	7.26	0	7.26	4.18	11.44	24	Pass
NVNT	n20	5955	Ant2	7.74	0	7.74	4.18	11.92	24	Pass
NVNT	n20	5955	Sum					14.7	24	Pass
NVNT	n20	6175	Ant1	6.02	0	6.02	4.18	10.2	24	Pass
NVNT	n20	6175	Ant2	6.8	0	6.8	4.18	10.98	24	Pass
NVNT	n20	6175	Sum					13.62	24	Pass
NVNT	n20	6415	Ant1	6.65	0	6.65	4.18	10.83	24	Pass
NVNT	n20	6415	Ant2	6.6	0	6.6	4.18	10.78	24	Pass
NVNT	n20	6415	Sum					13.82	24	Pass
NVNT	n20	6435	Ant1	6.89	0	6.89	4.18	11.07	24	Pass
NVNT	n20	6435	Ant2	7.25	0	7.25	4.18	11.43	24	Pass
NVNT	n20	6435	Sum					14.26	24	Pass
NVNT	n20	6475	Ant1	6.78	0	6.78	4.18	10.96	24	Pass
NVNT	n20	6475	Ant2	7.12	0	7.12	4.18	11.3	24	Pass
NVNT	n20	6475	Sum					14.14	24	Pass
NVNT	n20	6515	Ant1	5.87	0	5.87	4.18	10.05	24	Pass
NVNT	n20	6515	Ant2	5.83	0	5.83	4.18	10.01	24	Pass
NVNT	n20	6515	Sum					13.04	24	Pass
NVNT	n20	6535	Ant1	5.94	0	5.94	4.18	10.12	24	Pass
NVNT	n20	6535	Ant2	6.22	0	6.22	4.18	10.4	24	Pass
NVNT	n20	6535	Sum					13.27	24	Pass
NVNT	n20	6695	Ant1	6.49	0	6.49	4.18	10.67	24	Pass
NVNT	n20	6695	Ant2	6.68	0	6.68	4.18	10.86	24	Pass
NVNT	n20	6695	Sum					13.78	24	Pass
NVNT	n20	6855	Ant1	5.35	0	5.35	4.18	9.53	24	Pass
NVNT	n20	6855	Ant2	5.24	0	5.24	4.18	9.42	24	Pass
NVNT	n20	6855	Sum					12.49	24	Pass
NVNT	n20	6895	Ant1	5.36	0	5.36	4.18	9.54	24	Pass
NVNT	n20	6895	Ant2	5.27	0	5.27	4.18	9.45	24	Pass
NVNT	n20	6895	Sum					12.51	24	Pass
NVNT	n20	7115	Ant1	5.6	0	5.6	4.18	9.78	24	Pass
NVNT	n20	7115	Ant2	5.69	0	5.69	4.18	9.87	24	Pass
NVNT	n20	7115	Sum					12.84	24	Pass
NVNT	n40	5965	Ant1	5.92	0	5.92	4.18	10.1	24	Pass
NVNT	n40	6165	Ant1	5.92	0	5.92	4.18	10.1	24	Pass
NVNT	n40	6405	Ant1	7.07	0	7.07	4.18	11.25	24	Pass
NVNT	n40	6445	Ant1	7.58	0	7.58	4.18	11.76	24	Pass
NVNT	n40	6485	Ant1	7.57	0	7.57	4.18	11.75	24	Pass
NVNT	n40	6525	Ant1	6.17	0	6.17	4.18	10.35	24	Pass
NVNT	n40	6565	Ant1	5.7	0	5.7	4.18	9.88	24	Pass
NVNT	n40	6685	Ant1	7.12	0	7.12	4.18	11.3	24	Pass
NVNT	n40	6845	Ant1	6.18	0	6.18	4.18	10.36	24	Pass
NVNT	n40	6885	Ant1	5.91	0	5.91	4.18	10.09	24	Pass
NVNT	n40	6925	Ant1	5.56	0	5.56	4.18	9.74	24	Pass
NVNT	n40	6965	Ant1	5.79	0	5.79	4.18	9.97	24	Pass



NVNT	n40	7085	Ant1	5.55	0	5.55	4.18	9.73	24	Pass
NVNT	n40	5965	Ant2	7.85	0	7.85	4.18	12.03	24	Pass
NVNT	n40	6165	Ant2	7.06	0	7.06	4.18	11.24	24	Pass
NVNT	n40	6405	Ant2	6.67	0	6.67	4.18	10.85	24	Pass
NVNT	n40	6445	Ant2	7.13	0	7.13	4.18	11.31	24	Pass
NVNT	n40	6485	Ant2	7.44	0	7.44	4.18	11.62	24	Pass
NVNT	n40	6525	Ant2	6.69	0	6.69	4.18	10.87	24	Pass
NVNT	n40	6685	Ant2	7.37	0	7.37	4.18	11.55	24	Pass
NVNT	n40	6845	Ant2	5.79	0	5.79	4.18	9.97	24	Pass
NVNT	n40	6885	Ant2	5.69	0	5.69	4.18	9.87	24	Pass
NVNT	n40	6925	Ant2	5.81	0	5.81	4.18	9.99	24	Pass
NVNT	n40	6965	Ant2	6.43	0	6.43	4.18	10.61	24	Pass
NVNT	n40	7085	Ant2	5.71	0	5.71	4.18	9.89	24	Pass
NVNT	n40	5965	Ant1	8.28	0	8.28	4.18	12.46	24	Pass
NVNT	n40	5965	Ant2	7.62	0	7.62	4.18	11.8	24	Pass
NVNT	n40	5965	Sum					15.15	24	Pass
NVNT	n40	6165	Ant1	6.25	0	6.25	4.18	10.43	24	Pass
NVNT	n40	6165	Ant2	7.2	0	7.2	4.18	11.38	24	Pass
NVNT	n40	6165	Sum					13.94	24	Pass
NVNT	n40	6405	Ant1	6.94	0	6.94	4.18	11.12	24	Pass
NVNT	n40	6405	Ant2	6.9	0	6.9	4.18	11.08	24	Pass
NVNT	n40	6405	Sum					14.11	24	Pass
NVNT	n40	6445	Ant1	7.07	0	7.07	4.18	11.25	24	Pass
NVNT	n40	6445	Ant2	6.39	0	6.39	4.18	10.57	24	Pass
NVNT	n40	6445	Sum					13.93	24	Pass
NVNT	n40	6485	Ant1	7.48	0	7.48	4.18	11.66	24	Pass
NVNT	n40	6485	Ant2	7.56	0	7.56	4.18	11.74	24	Pass
NVNT	n40	6485	Sum					14.71	24	Pass
NVNT	n40	6525	Ant1	6.51	0	6.51	4.18	10.69	24	Pass
NVNT	n40	6525	Ant2	6.81	0	6.81	4.18	10.99	24	Pass
NVNT	n40	6525	Sum					13.85	24	Pass
NVNT	n40	6565	Ant1	6.22	0	6.22	4.18	10.4	24	Pass
NVNT	n40	6565	Ant2	6.1	0	6.1	4.18	10.28	24	Pass
NVNT	n40	6565	Sum					13.35	24	Pass
NVNT	n40	6685	Ant1	7.3	0	7.3	4.18	11.48	24	Pass
NVNT	n40	6685	Ant2	7.35	0	7.35	4.18	11.53	24	Pass
NVNT	n40	6685	Sum					14.52	24	Pass
NVNT	n40	6845	Ant1	5.97	0	5.97	4.18	10.15	24	Pass
NVNT	n40	6845	Ant2	5.63	0	5.63	4.18	9.81	24	Pass
NVNT	n40	6845	Sum					12.99	24	Pass
NVNT	n40	6885	Ant1	5.83	0	5.83	4.18	10.01	24	Pass
NVNT	n40	6885	Ant2	5.52	0	5.52	4.18	9.7	24	Pass
NVNT	n40	6885	Sum					12.87	24	Pass
NVNT	n40	6925	Ant1	5.78	0	5.78	4.18	9.96	24	Pass
NVNT	n40	6925	Ant2	5.89	0	5.89	4.18	10.07	24	Pass
NVNT	n40	6925	Sum					13.03	24	Pass



NVNT	n40	6965	Ant1	6.17	0	6.17	4.18	10.35	24	Pass
NVNT	n40	6965	Ant2	6.46	0	6.46	4.18	10.64	24	Pass
NVNT	n40	6965	Sum					13.51	24	Pass
NVNT	n40	7085	Ant1	5.7	0	5.7	4.18	9.88	24	Pass
NVNT	n40	7085	Ant2	6.04	0	6.04	4.18	10.22	24	Pass
NVNT	n40	7085	Sum					13.06	24	Pass
NVNT	ac80	5985	Ant1	7.52	0	7.52	4.18	11.7	24	Pass
NVNT	ac80	6145	Ant1	6.11	0	6.11	4.18	10.29	24	Pass
NVNT	ac80	6385	Ant1	6.94	0	6.94	4.18	11.12	24	Pass
NVNT	ac80	6465	Ant1	7.38	0	7.38	4.18	11.56	24	Pass
NVNT	ac80	6545	Ant1	5.96	0	5.96	4.18	10.14	24	Pass
NVNT	ac80	6625	Ant1	6.76	0	6.76	4.18	10.94	24	Pass
NVNT	ac80	6705	Ant1	7.17	0	7.17	4.18	11.35	24	Pass
NVNT	ac80	6785	Ant1	6.46	0	6.46	4.18	10.64	24	Pass
NVNT	ac80	6865	Ant1	6.41	0	6.41	4.18	10.59	24	Pass
NVNT	ac80	6945	Ant1	5.68	0	5.68	4.18	9.86	24	Pass
NVNT	ac80	7025	Ant1	4.62	0	4.62	4.18	8.8	24	Pass
NVNT	ac80	5985	Ant2	7.89	0	7.89	4.18	12.07	24	Pass
NVNT	ac80	6145	Ant2	6.16	0	6.16	4.18	10.34	24	Pass
NVNT	ac80	6465	Ant2	7.07	0	7.07	4.18	11.25	24	Pass
NVNT	ac80	6545	Ant2	6.34	0	6.34	4.18	10.52	24	Pass
NVNT	ac80	6625	Ant2	6.61	0	6.61	4.18	10.79	24	Pass
NVNT	ac80	6705	Ant2	6.66	0	6.66	4.18	10.84	24	Pass
NVNT	ac80	6785	Ant2	5.62	0	5.62	4.18	9.8	24	Pass
NVNT	ac80	6865	Ant2	5.97	0	5.97	4.18	10.15	24	Pass
NVNT	ac80	6945	Ant2	5.8	0	5.8	4.18	9.98	24	Pass
NVNT	ac80	7025	Ant2	4.56	0	4.56	4.18	8.74	24	Pass
NVNT	ac80	5985	Ant1	8.07	0	8.07	4.18	12.25	24	Pass
NVNT	ac80	5985	Ant2	7.95	0	7.95	4.18	12.13	24	Pass
NVNT	ac80	5985	Sum					15.2	24	Pass
NVNT	ac80	6145	Ant1	5.94	0	5.94	4.18	10.12	24	Pass
NVNT	ac80	6145	Ant2	6.63	0	6.63	4.18	10.81	24	Pass
NVNT	ac80	6145	Sum					13.49	24	Pass
NVNT	ac80	6385	Ant1	6.7	0	6.7	4.18	10.88	24	Pass
NVNT	ac80	6385	Ant2	6.55	0	6.55	4.18	10.73	24	Pass
NVNT	ac80	6385	Sum					13.82	24	Pass
NVNT	ac80	6465	Ant1	7.11	0	7.11	4.18	11.29	24	Pass
NVNT	ac80	6465	Ant2	7.56	0	7.56	4.18	11.74	24	Pass
NVNT	ac80	6465	Sum					14.53	24	Pass
NVNT	ac80	6545	Ant1	5.96	0	5.96	4.18	10.14	24	Pass
NVNT	ac80	6545	Ant2	6.38	0	6.38	4.18	10.56	24	Pass
NVNT	ac80	6545	Sum					13.37	24	Pass
NVNT	ac80	6625	Ant1	6.39	0	6.39	4.18	10.57	24	Pass
NVNT	ac80	6625	Ant2	6.25	0	6.25	4.18	10.43	24	Pass
NVNT	ac80	6625	Sum					13.51	24	Pass
NVNT	ac80	6705	Ant1	6.96	0	6.96	4.18	11.14	24	Pass



NVNT	ac80	6705	Ant2	7.17	0	7.17	4.18	11.35	24	Pass
NVNT	ac80	6705	Sum					14.26	24	Pass
NVNT	ac80	6785	Ant1	6.02	0	6.02	4.18	10.2	24	Pass
NVNT	ac80	6785	Ant2	6.03	0	6.03	4.18	10.21	24	Pass
NVNT	ac80	6785	Sum					13.22	24	Pass
NVNT	ac80	6865	Ant1	6.13	0	6.13	4.18	10.31	24	Pass
NVNT	ac80	6865	Ant2	5.87	0	5.87	4.18	10.05	24	Pass
NVNT	ac80	6865	Sum					13.19	24	Pass
NVNT	ac80	6945	Ant1	5.7	0	5.7	4.18	9.88	24	Pass
NVNT	ac80	6945	Ant2	5.87	0	5.87	4.18	10.05	24	Pass
NVNT	ac80	6945	Sum					12.98	24	Pass
NVNT	ac80	7025	Ant1	4.73	0	4.73	4.18	8.91	24	Pass
NVNT	ac80	7025	Ant2	5.27	0	5.27	4.18	9.45	24	Pass
NVNT	ac80	7025	Sum					12.2	24	Pass
NVNT	ax80	5985	Ant1	5.55	0	5.55	4.18	9.73	24	Pass
NVNT	ax80	6145	Ant1	6.55	0	6.55	4.18	10.73	24	Pass
NVNT	ax80	6385	Ant1	6.78	0	6.78	4.18	10.96	24	Pass
NVNT	ax80	6465	Ant1	7.05	0	7.05	4.18	11.23	24	Pass
NVNT	ax80	6545	Ant1	5.46	0	5.46	4.18	9.64	24	Pass
NVNT	ax80	6625	Ant1	6.71	0	6.71	4.18	10.89	24	Pass
NVNT	ax80	6705	Ant1	6.74	0	6.74	4.18	10.92	24	Pass
NVNT	ax80	6785	Ant1	6.22	0	6.22	4.18	10.4	24	Pass
NVNT	ax80	6865	Ant1	6.21	0	6.21	4.18	10.39	24	Pass
NVNT	ax80	6945	Ant1	5.46	0	5.46	4.18	9.64	24	Pass
NVNT	ax80	7025	Ant1	4.43	0	4.43	4.18	8.61	24	Pass
NVNT	ax80	5985	Ant2	7.74	0	7.74	4.18	11.92	24	Pass
NVNT	ax80	6145	Ant2	6.87	0	6.87	4.18	11.05	24	Pass
NVNT	ax80	6385	Ant2	6.56	0	6.56	4.18	10.74	24	Pass
NVNT	ax80	6465	Ant2	7.03	0	7.03	4.18	11.21	24	Pass
NVNT	ax80	6545	Ant2	6.2	0	6.2	4.18	10.38	24	Pass
NVNT	ax80	6625	Ant2	6.58	0	6.58	4.18	10.76	24	Pass
NVNT	ax80	6705	Ant2	6.47	0	6.47	4.18	10.65	24	Pass
NVNT	ax80	6785	Ant2	5.49	0	5.49	4.18	9.67	24	Pass
NVNT	ax80	6865	Ant2	5.7	0	5.7	4.18	9.88	24	Pass
NVNT	ax80	7025	Ant2	4.27	0	4.27	4.18	8.45	24	Pass
NVNT	ax80	5985	Ant1	7.8	0	7.8	4.18	11.98	24	Pass
NVNT	ax80	5985	Ant2	6.92	0	6.92	4.18	11.1	24	Pass
NVNT	ax80	5985	Sum					14.57	24	Pass
NVNT	ax80	6145	Ant1	5.76	0	5.76	4.18	9.94	24	Pass
NVNT	ax80	6145	Ant2	5.6	0	5.6	4.18	9.78	24	Pass
NVNT	ax80	6145	Sum					12.87	24	Pass
NVNT	ax80	6385	Ant1	6.47	0	6.47	4.18	10.65	24	Pass
NVNT	ax80	6385	Ant2	6.24	0	6.24	4.18	10.42	24	Pass
NVNT	ax80	6385	Sum					13.55	24	Pass
NVNT	ax80	6465	Ant1	6.9	0	6.9	4.18	11.08	24	Pass
NVNT	ax80	6465	Ant2	7	0	7	4.18	11.18	24	Pass



NVNT	ax80	6465	Sum					14.14	24	Pass
NVNT	ax80	6545	Ant1	5.76	0	5.76	4.18	9.94	24	Pass
NVNT	ax80	6545	Ant2	5.86	0	5.86	4.18	10.04	24	Pass
NVNT	ax80	6545	Sum					13	24	Pass
NVNT	ax80	6625	Ant1	6.55	0	6.55	4.18	10.73	24	Pass
NVNT	ax80	6625	Ant2	6.24	0	6.24	4.18	10.42	24	Pass
NVNT	ax80	6625	Sum					13.59	24	Pass
NVNT	ax80	6705	Ant1	6.77	0	6.77	4.18	10.95	24	Pass
NVNT	ax80	6705	Ant2	6.82	0	6.82	4.18	11	24	Pass
NVNT	ax80	6705	Sum					13.99	24	Pass
NVNT	ax80	6785	Ant1	5.78	0	5.78	4.18	9.96	24	Pass
NVNT	ax80	6785	Ant2	5.48	0	5.48	4.18	9.66	24	Pass
NVNT	ax80	6785	Sum					12.82	24	Pass
NVNT	ax80	6865	Ant1	5.99	0	5.99	4.18	10.17	24	Pass
NVNT	ax80	6865	Ant2	5.37	0	5.37	4.18	9.55	24	Pass
NVNT	ax80	6865	Sum					12.88	24	Pass
NVNT	ax80	6945	Ant1	5.46	0	5.46	4.18	9.64	24	Pass
NVNT	ax80	6945	Ant2	4.93	0	4.93	4.18	9.11	24	Pass
NVNT	ax80	6945	Sum					12.39	24	Pass
NVNT	ax80	7025	Ant1	4.46	0	4.46	4.18	8.64	24	Pass
NVNT	ax80	7025	Ant2	4.72	0	4.72	4.18	8.9	24	Pass
NVNT	ax80	7025	Sum					11.78	24	Pass
NVNT	ax160	6025	Ant1	7.02	0	7.02	4.18	11.2	24	Pass
NVNT	ax160	6185	Ant1	7.24	0	7.24	4.18	11.42	24	Pass
NVNT	ax160	6345	Ant1	6.87	0	6.87	4.18	11.05	24	Pass
NVNT	ax160	6505	Ant1	6.77	0	6.77	4.18	10.95	24	Pass
NVNT	ax160	6665	Ant1	7.66	0	7.66	4.18	11.84	24	Pass
NVNT	ax160	6825	Ant1	6.63	0	6.63	4.18	10.81	24	Pass
NVNT	ax160	6985	Ant1	5.14	0	5.14	4.18	9.32	24	Pass
NVNT	ax160	6025	Ant2	7.89	0	7.89	4.18	12.07	24	Pass
NVNT	ax160	6185	Ant2	7.54	0	7.54	4.18	11.72	24	Pass
NVNT	ax160	6345	Ant2	7.51	0	7.51	4.18	11.69	24	Pass
NVNT	ax160	6505	Ant2	6.89	0	6.89	4.18	11.07	24	Pass
NVNT	ax160	6665	Ant2	7.13	0	7.13	4.18	11.31	24	Pass
NVNT	ax160	6825	Ant2	6.41	0	6.41	4.18	10.59	24	Pass
NVNT	ax160	6985	Ant2	5.28	0	5.28	4.18	9.46	24	Pass
NVNT	ax160	6025	Ant1	7.24	0	7.24	4.18	11.42	24	Pass
NVNT	ax160	6025	Ant2	7.63	0	7.63	4.18	11.81	24	Pass
NVNT	ax160	6025	Sum					14.63	24	Pass
NVNT	ax160	6185	Ant1	7.19	0	7.19	4.18	11.37	24	Pass
NVNT	ax160	6185	Ant2	7.64	0	7.64	4.18	11.82	24	Pass
NVNT	ax160	6185	Sum					14.61	24	Pass
NVNT	ax160	6345	Ant1	6.73	0	6.73	4.18	10.91	24	Pass
NVNT	ax160	6345	Ant2	7.63	0	7.63	4.18	11.81	24	Pass
NVNT	ax160	6345	Sum					14.39	24	Pass
NVNT	ax160	6505	Ant1	6.45	0	6.45	4.18	10.63	24	Pass



NVNT	ax160	6505	Ant2	6.87	0	6.87	4.18	11.05	24	Pass
NVNT	ax160	6505	Sum					13.86	24	Pass
NVNT	ax160	6665	Ant1	7.24	0	7.24	4.18	11.42	24	Pass
NVNT	ax160	6665	Ant2	6.98	0	6.98	4.18	11.16	24	Pass
NVNT	ax160	6665	Sum					14.3	24	Pass
NVNT	ax160	6825	Ant1	6.24	0	6.24	4.18	10.42	24	Pass
NVNT	ax160	6825	Ant2	6.3	0	6.3	4.18	10.48	24	Pass
NVNT	ax160	6825	Sum					13.46	24	Pass
NVNT	ax160	6985	Ant1	5.14	0	5.14	4.18	9.32	24	Pass
NVNT	ax160	6985	Ant2	5.53	0	5.53	4.18	9.71	24	Pass
NVNT	ax160	6985	Sum					12.53	24	Pass



