

Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	Range1:30~1000MHz	-46.11	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	Range2:1000~20000MHz	-38.57	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-46.18	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-37.47	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range1:30~1000MHz	-46.67	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range2:1000~20000MHz	-38.62	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range1:30~1000MHz	-44.49	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range2:1000~20000MHz	-38.37	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-46.29	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-38.6	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range1:30~1000MHz	-45.92	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range2:1000~20000MHz	-38.97	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range1:30~1000MHz	-46	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range2:1000~20000MHz	-38.15	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-45.47	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-38.46	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range1:30~1000MHz	-45.53	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range2:1000~20000MHz	-38.12	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	3MHz	16QAM	18615	1RB#0	Range1:30~1000MHz	-46.06	PASS
Band2	3MHz	16QAM	18615	1RB#0	Range2:1000~20000MHz	-38.77	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-46.33	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-37.93	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range1:30~1000MHz	-47.1	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range2:1000~20000MHz	-38.99	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range1:30~1000MHz	-46.94	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range2:1000~20000MHz	-39.07	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-45.56	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-38.81	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range1:30~1000MHz	-46.72	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range2:1000~20000MHz	-37.96	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range1:30~1000MHz	-46.7	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range2:1000~20000MHz	-38.64	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-45.87	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-38.15	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range1:30~1000MHz	-44.65	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range2:1000~20000MHz	-38.92	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range1:30~1000MHz	-46.91	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range2:1000~20000MHz	-38.4	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-45.58	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-38.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	10MHz	QPSK	19150	1RB#0	Range1:30~1000MHz	-46.54	PASS
Band2	10MHz	QPSK	19150	1RB#0	Range2:1000~20000MHz	-39	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range1:30~1000MHz	-47.19	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range2:1000~20000MHz	-38.92	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-46.82	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-38.97	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range1:30~1000MHz	-45.77	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range2:1000~20000MHz	-38.36	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range1:30~1000MHz	-46.4	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range2:1000~20000MHz	-38.56	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-45.29	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-38.76	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range1:30~1000MHz	-47.13	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range2:1000~20000MHz	-38.19	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range1:30~1000MHz	-46.42	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range2:1000~20000MHz	-37.93	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-46.48	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-38.08	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range1:30~1000MHz	-47.81	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range2:1000~20000MHz	-38.94	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range1:30~1000MHz	-46.5	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range2:1000~20000MHz	-37.95	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Band2	20MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-46.28	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-38.99	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range1:30~1000MHz	-46.1	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range2:1000~20000MHz	-38.58	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range1:30~1000MHz	-47.1	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range2:1000~20000MHz	-38.36	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-46.36	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-38.15	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range1:30~1000MHz	-47.14	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range2:1000~20000MHz	-38.8	PASS

Test Graphs

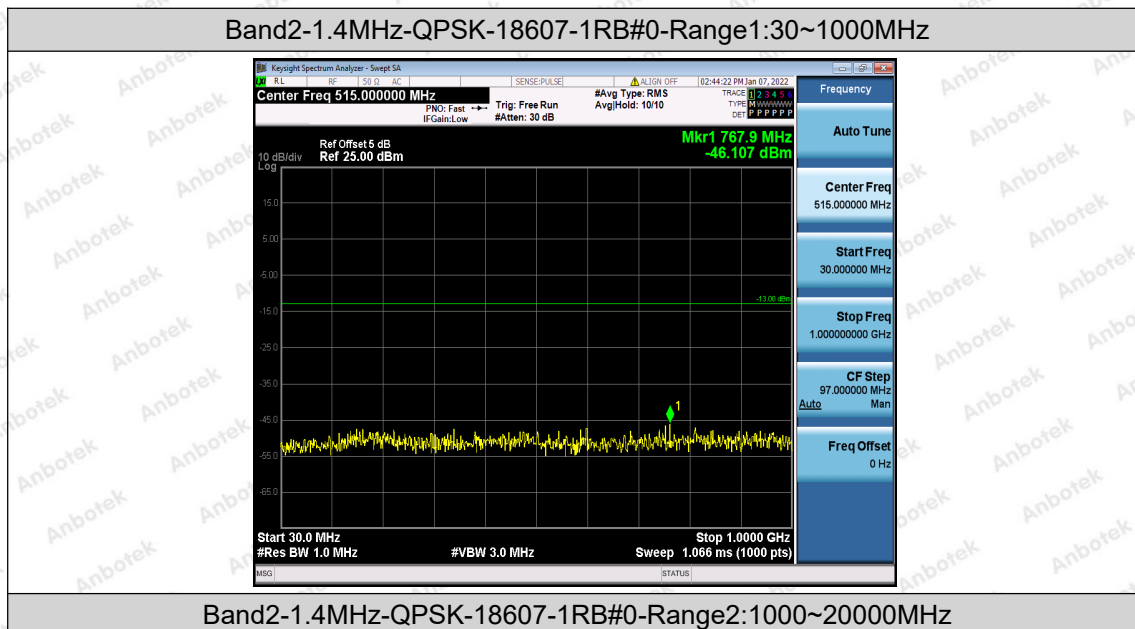


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

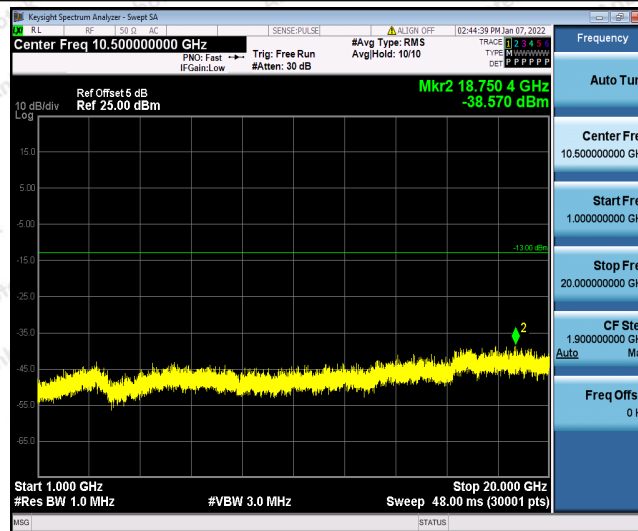

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

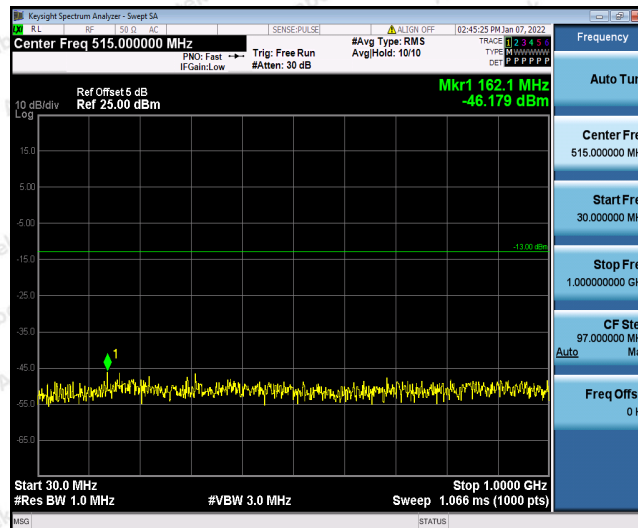

Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

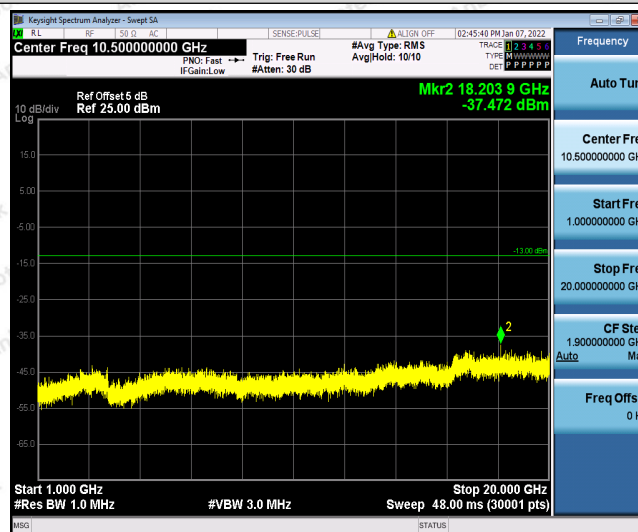


Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

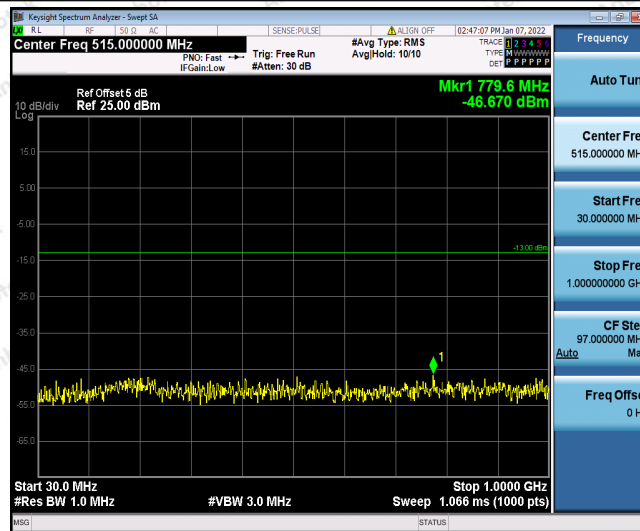

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

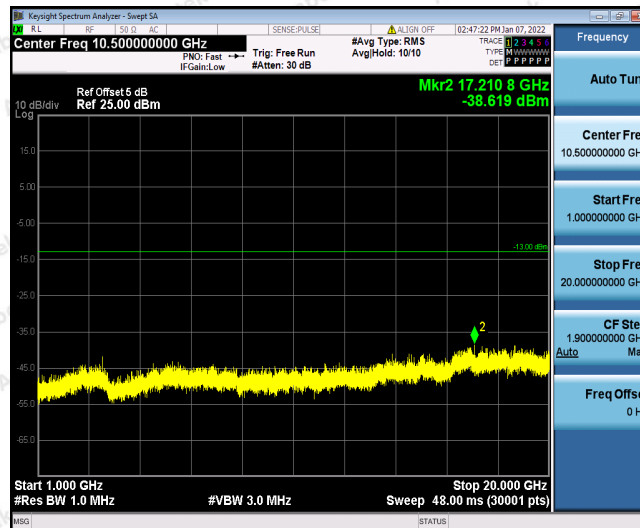

Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz

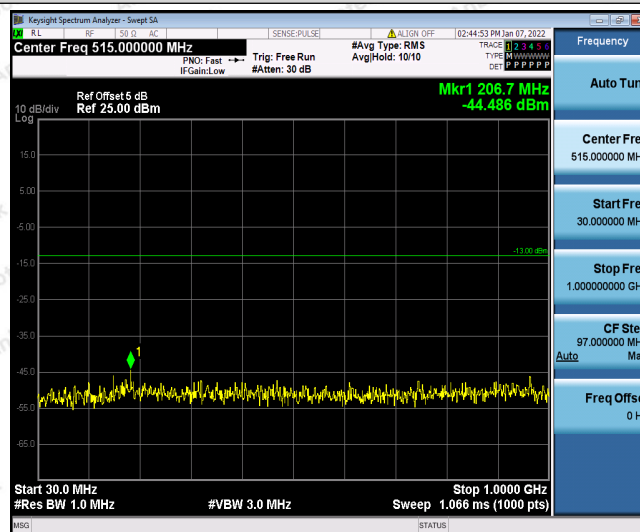


Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

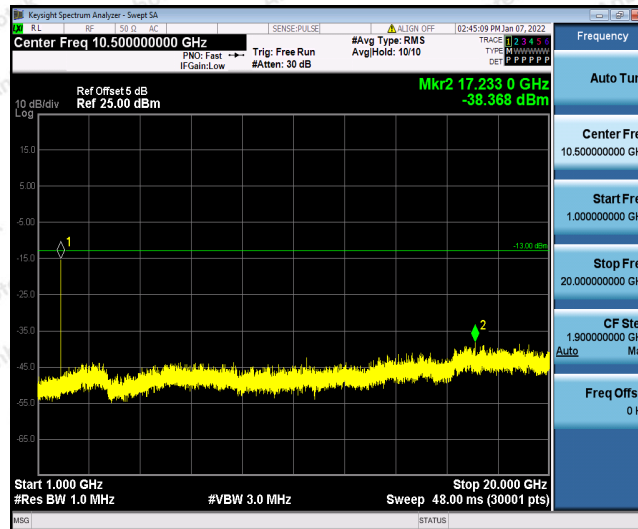

Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

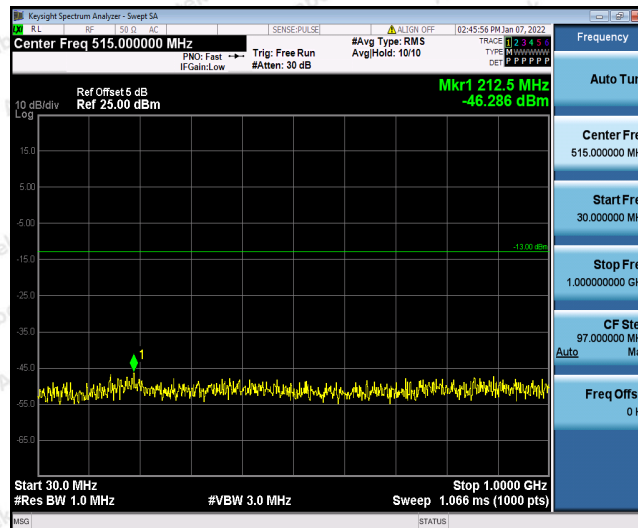

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

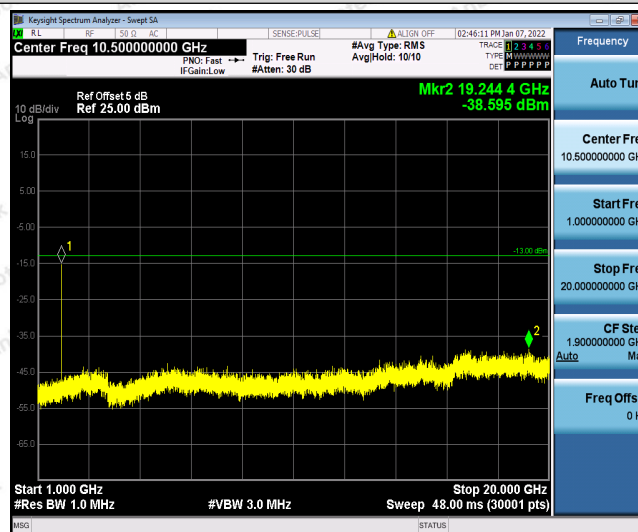


Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

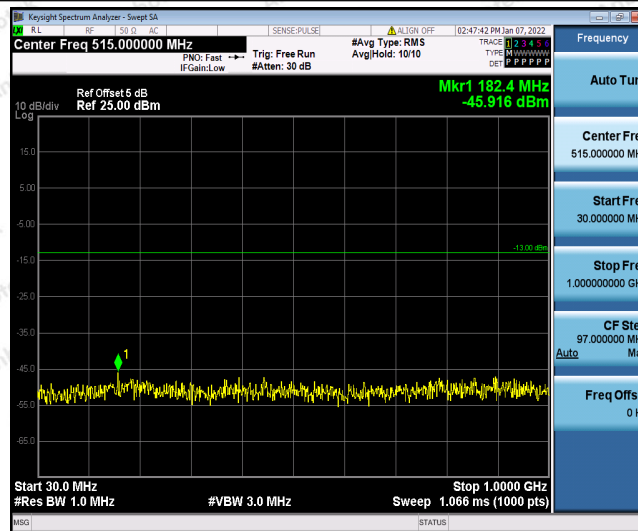

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz

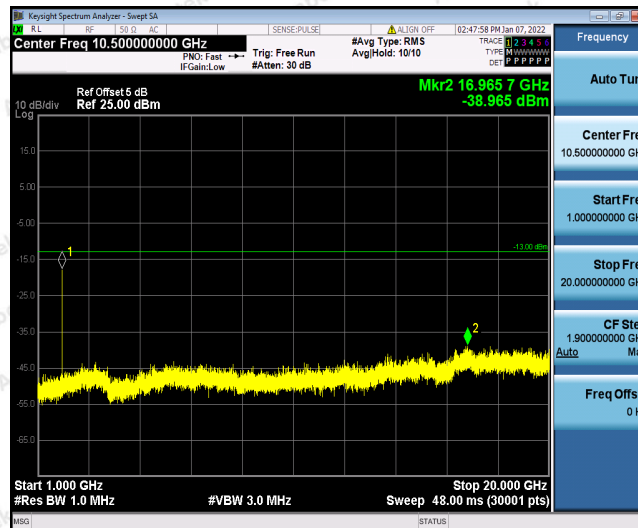

Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz

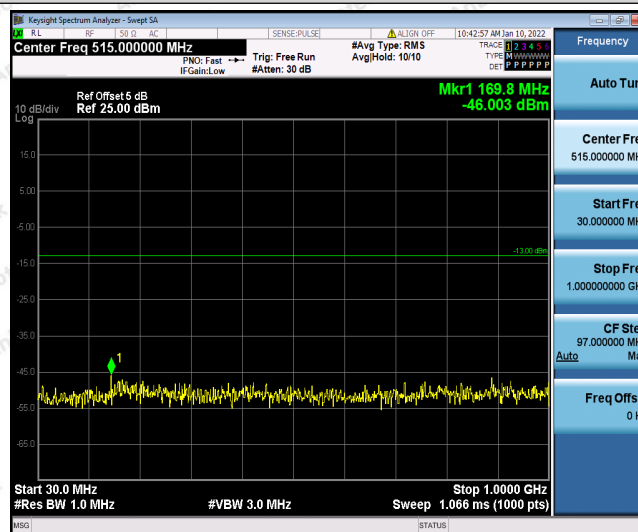


Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

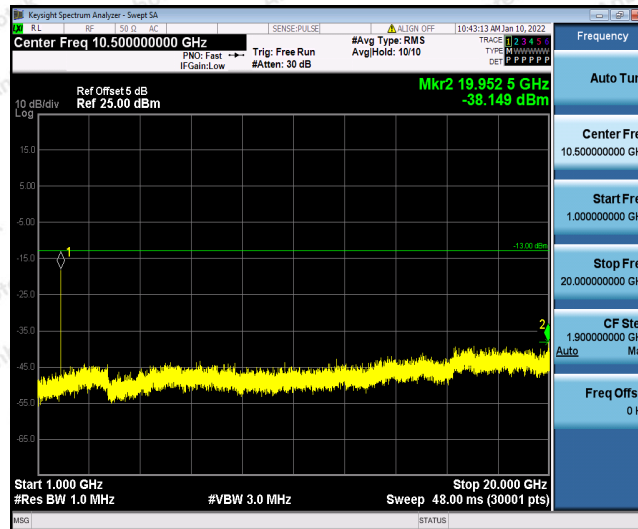

Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

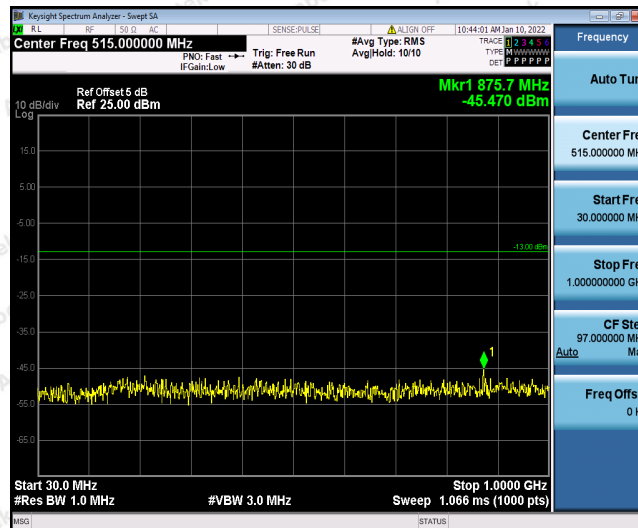

Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

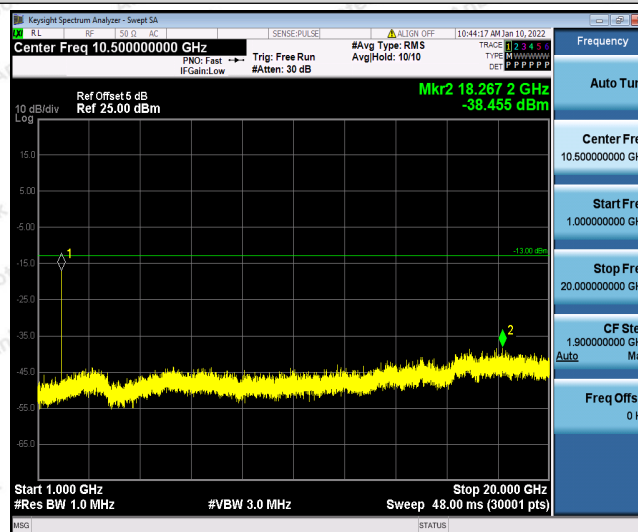


Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

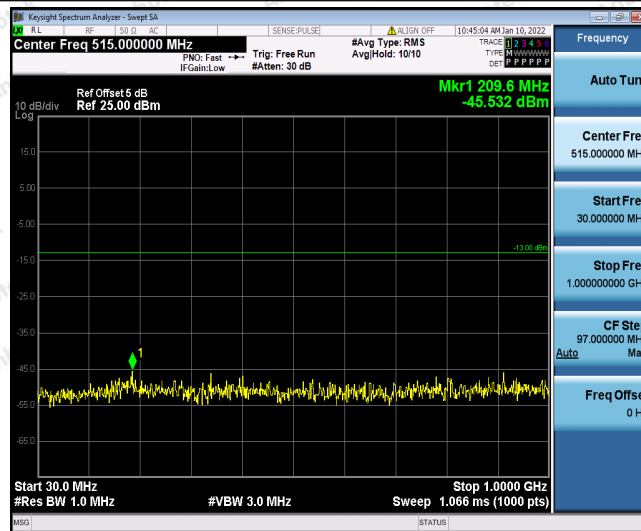

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

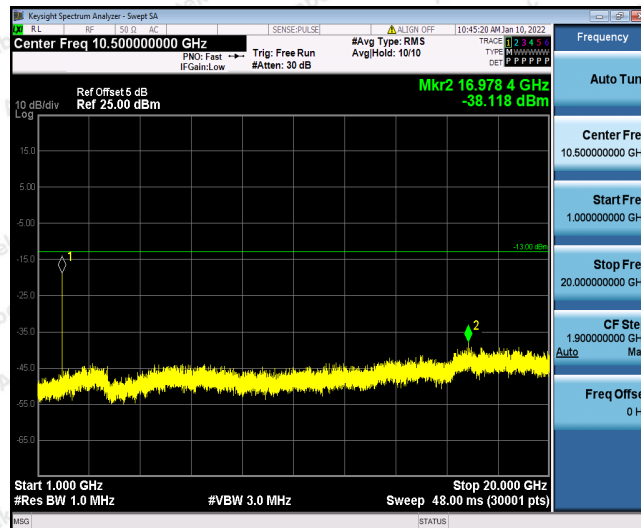

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz

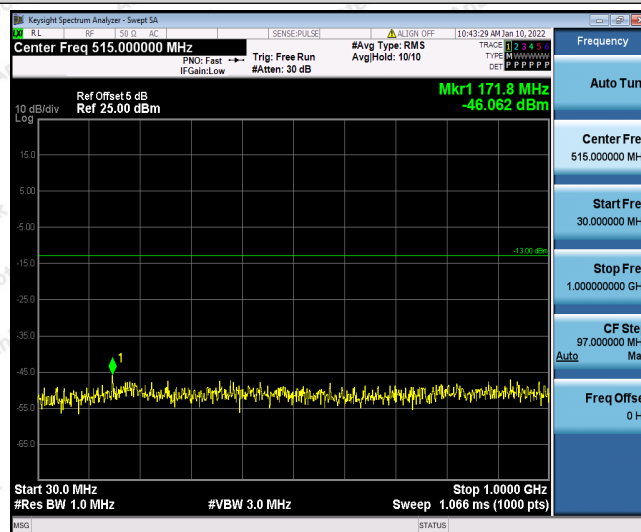


Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

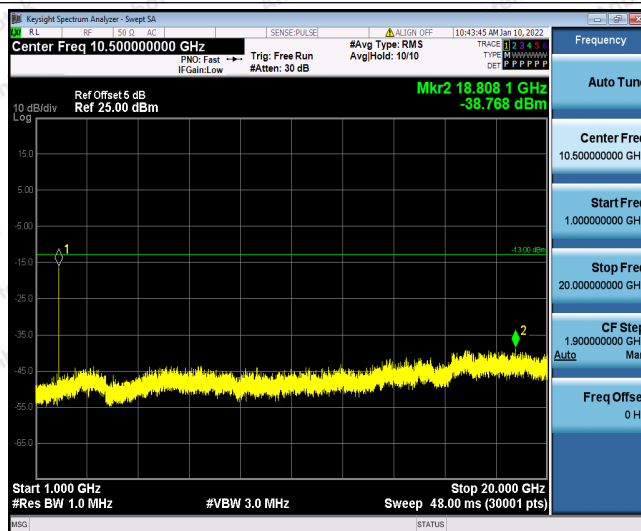

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

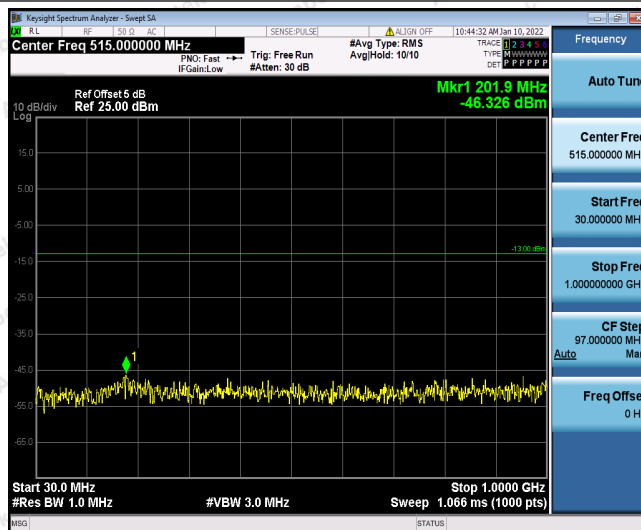

Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

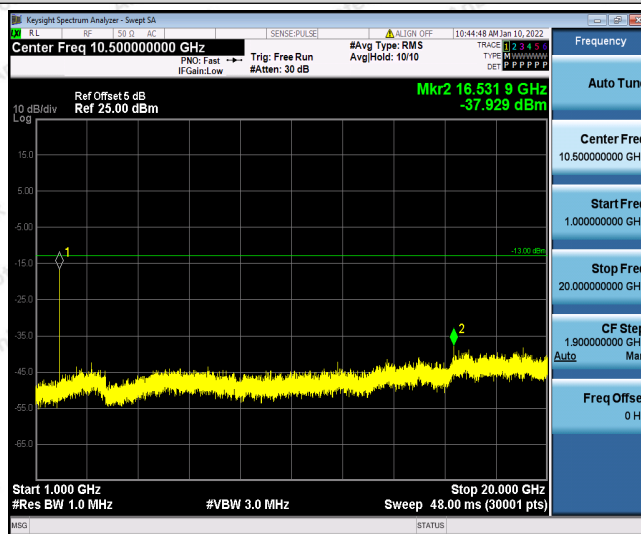

Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com




Hotline

400-003-0500


www.anbotech.com

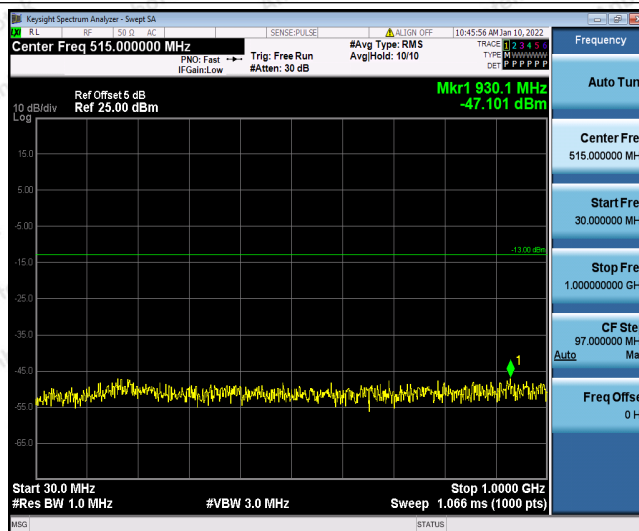

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

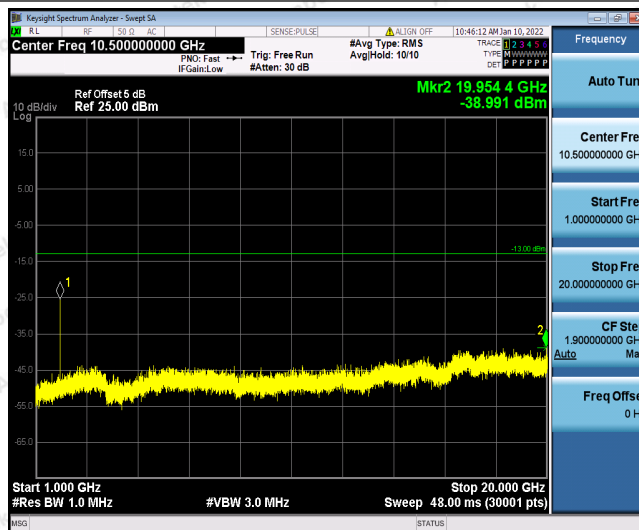

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz

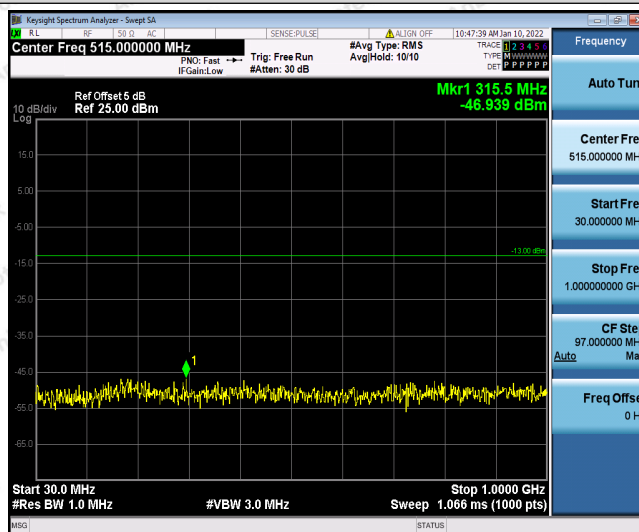

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

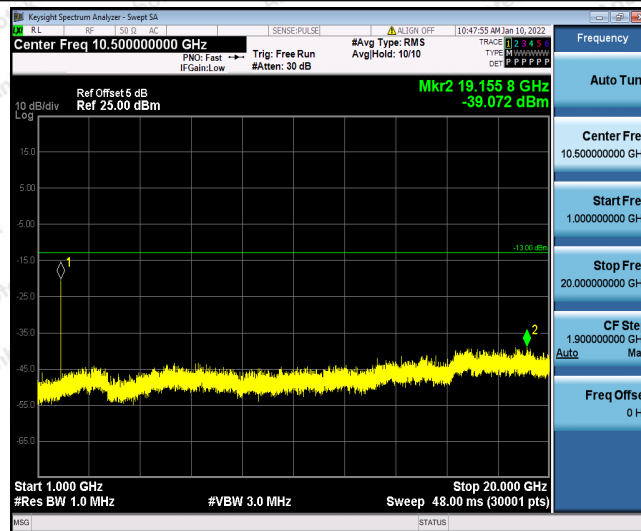

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

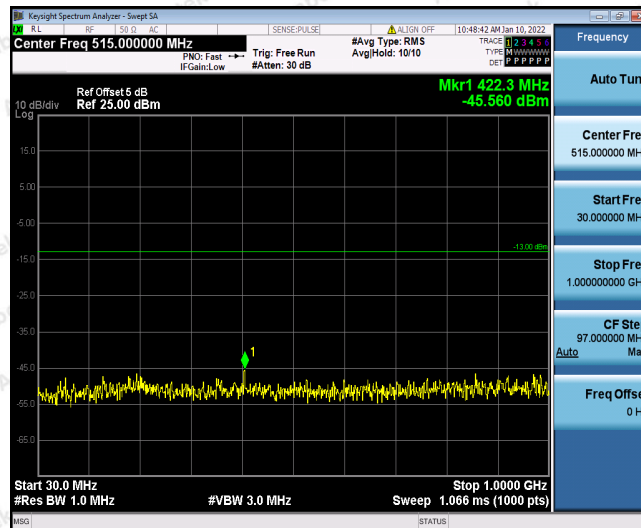

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

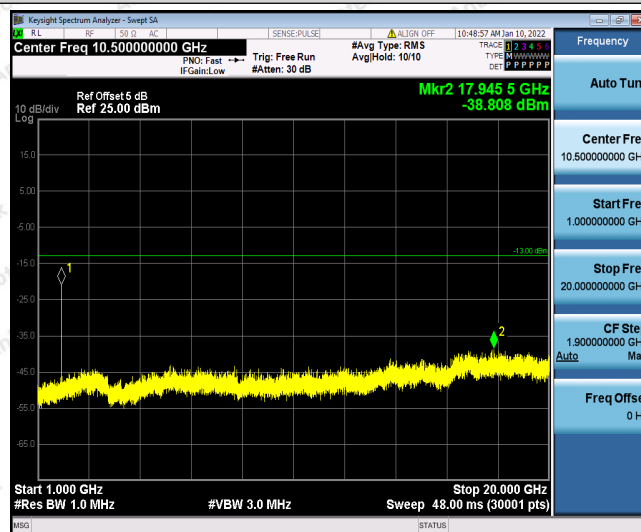


Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

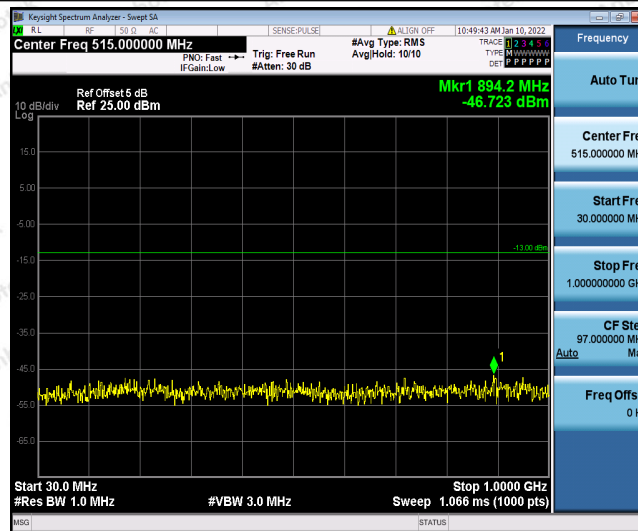

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

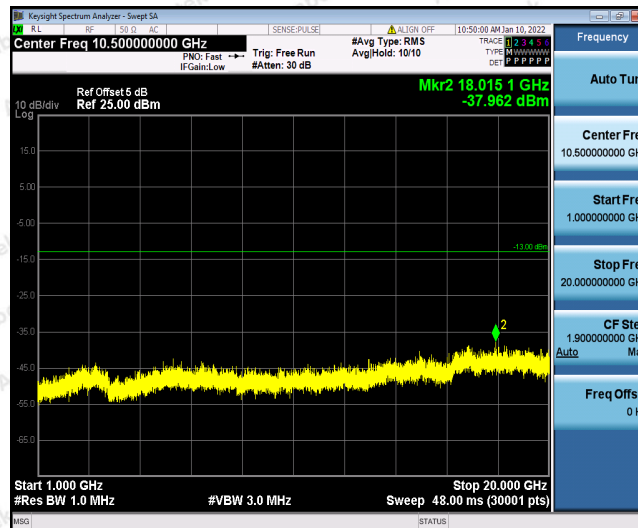

Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz

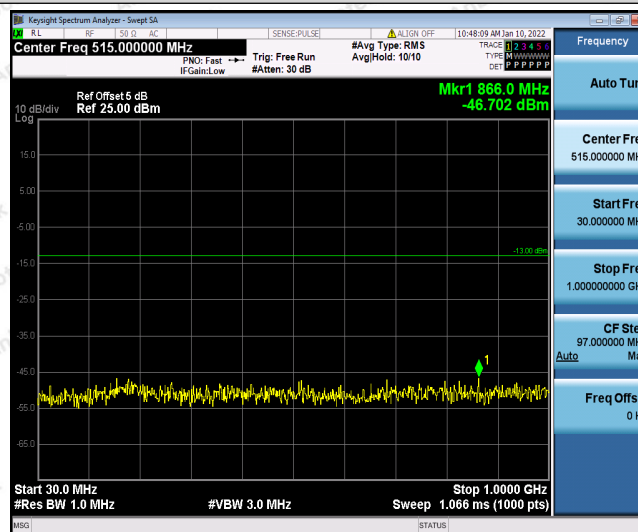


Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

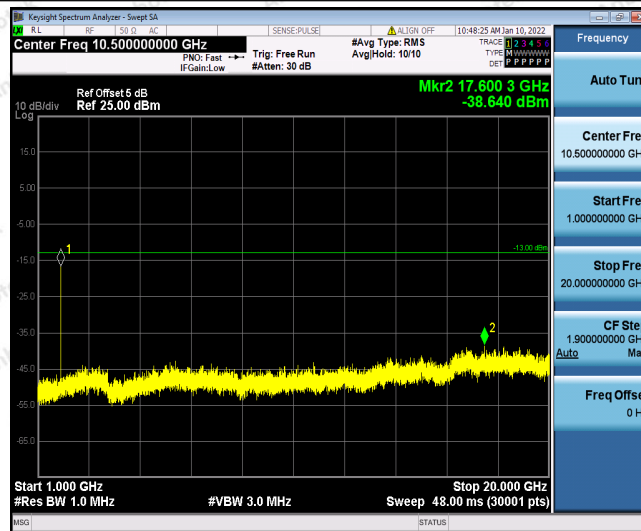

Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

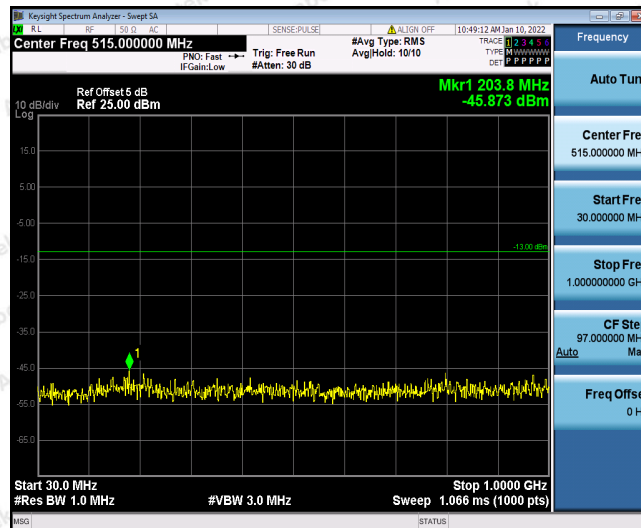

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

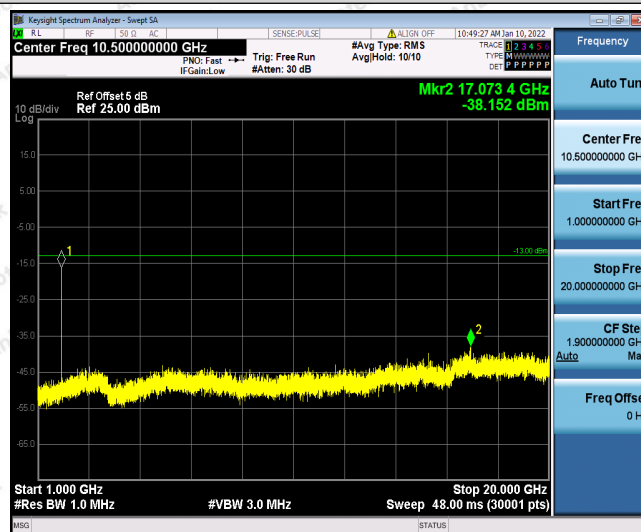


Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

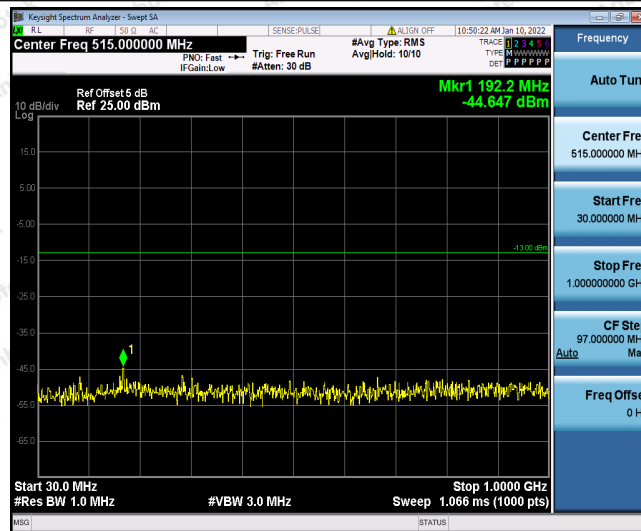

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz

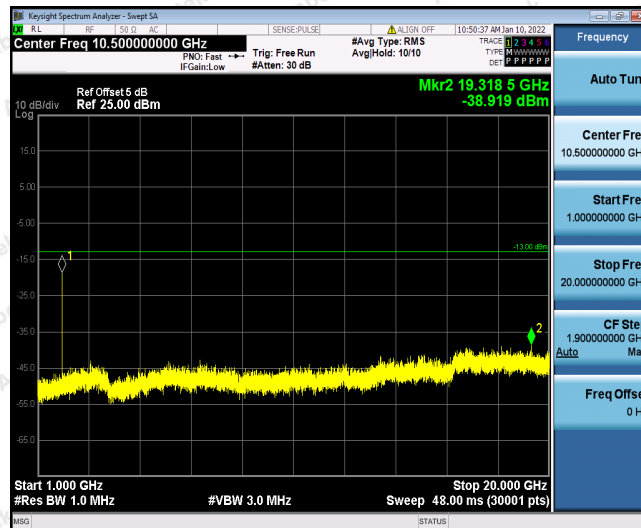

Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz

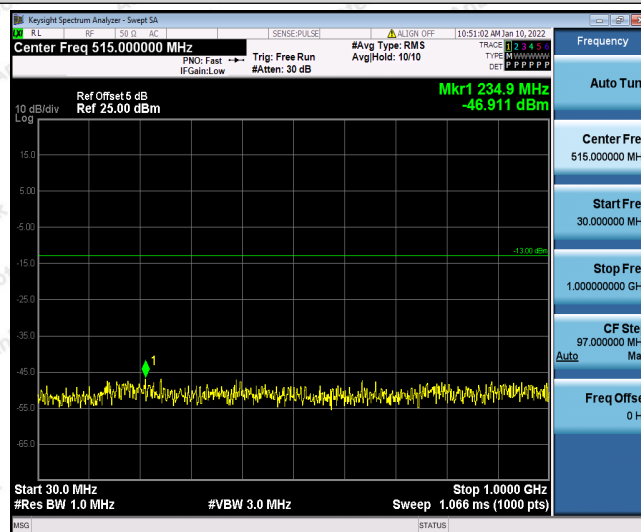


Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

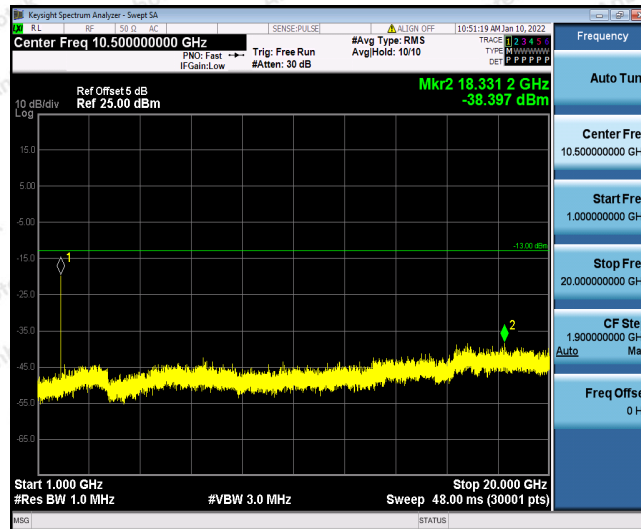

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

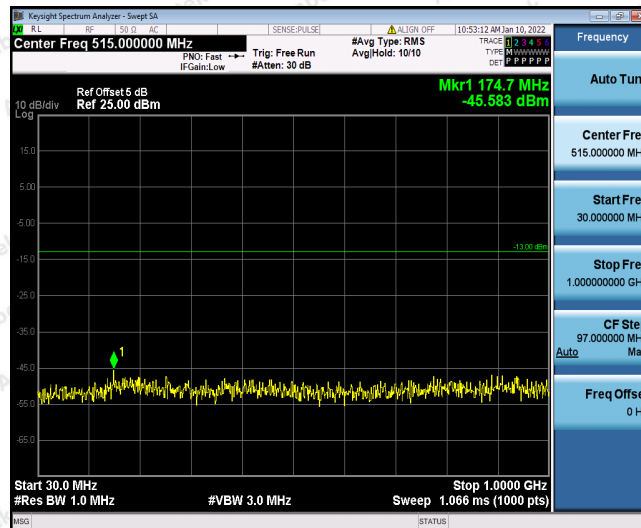

Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

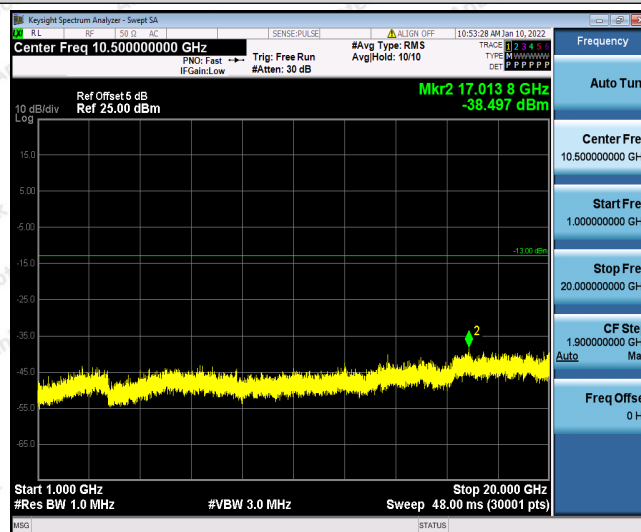

Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

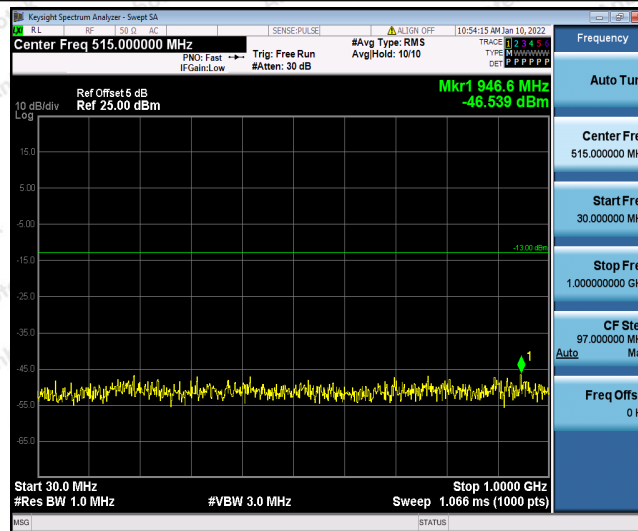


Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz

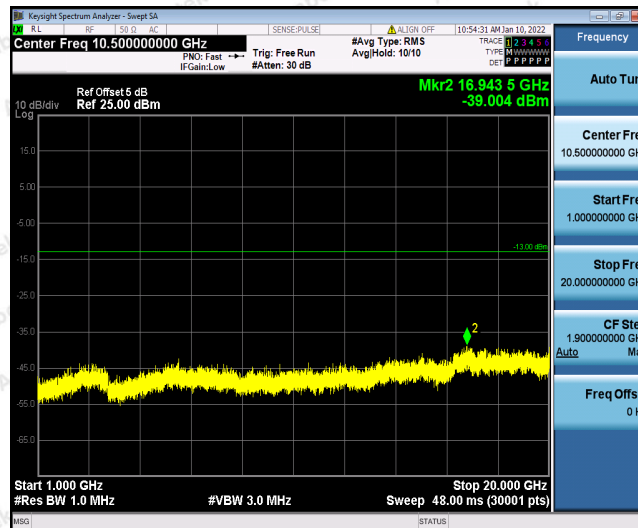


Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz

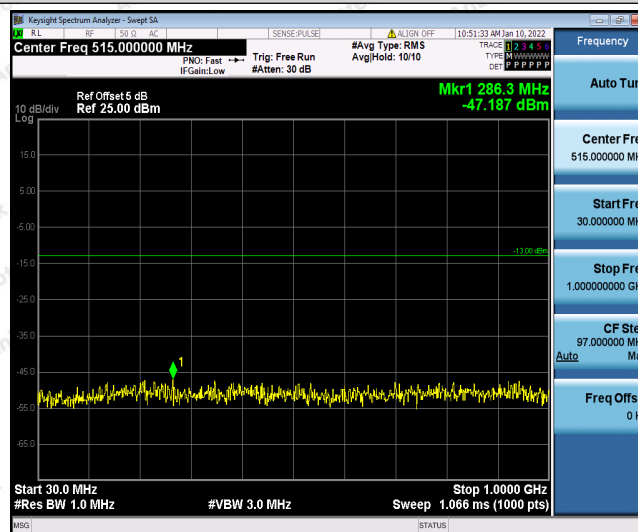


Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz

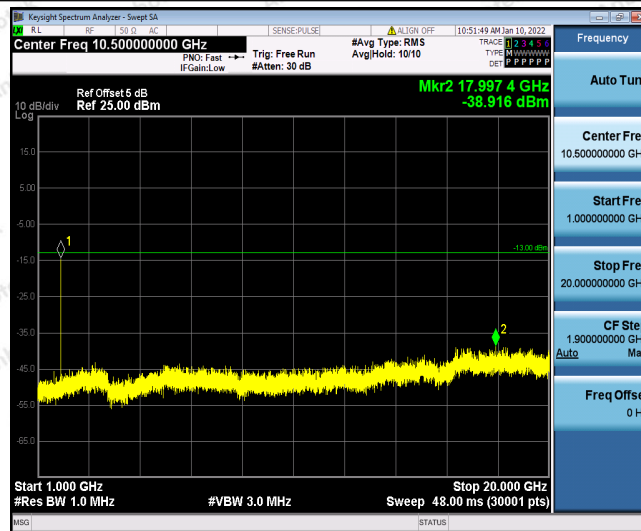

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

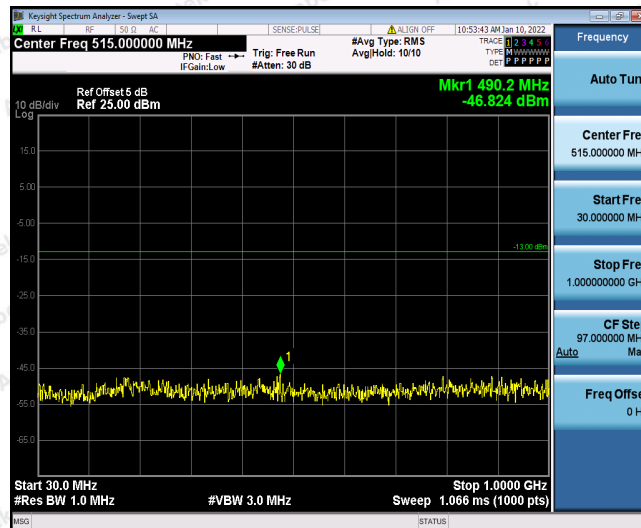

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

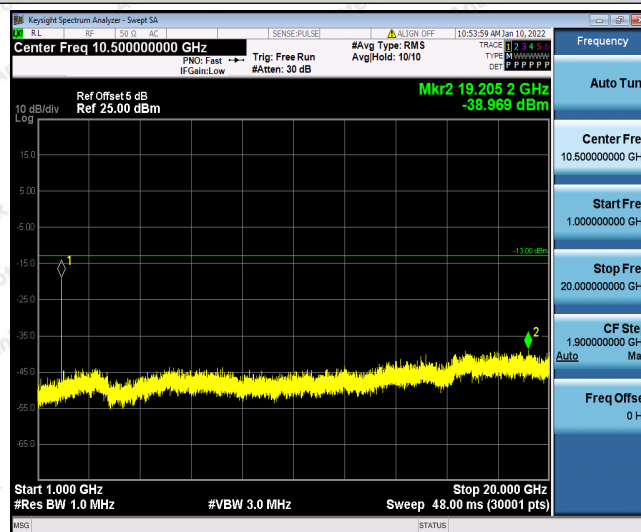


Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

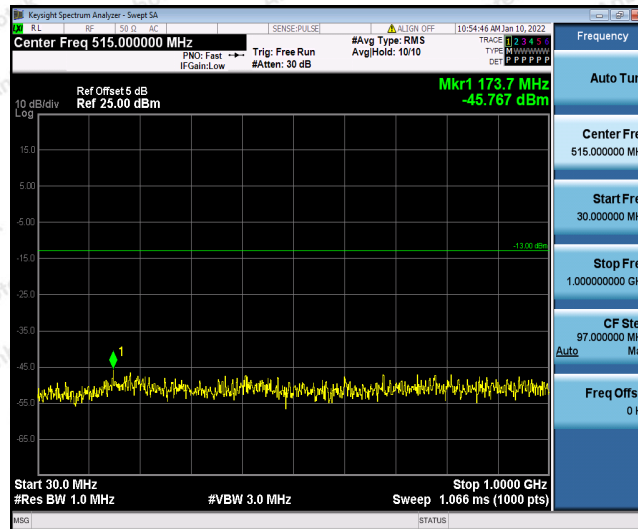

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

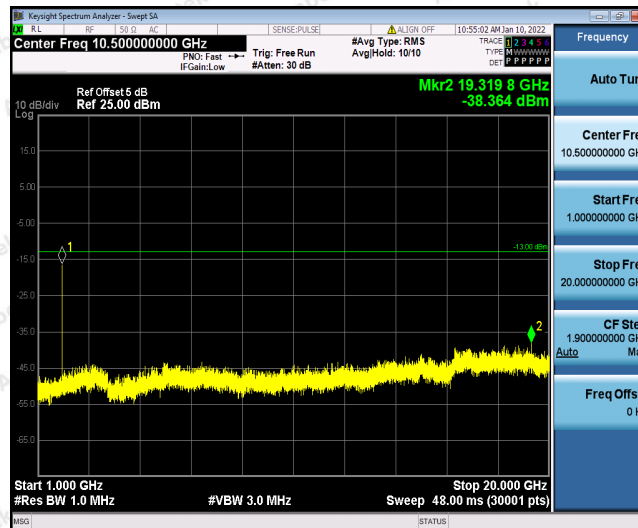

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz

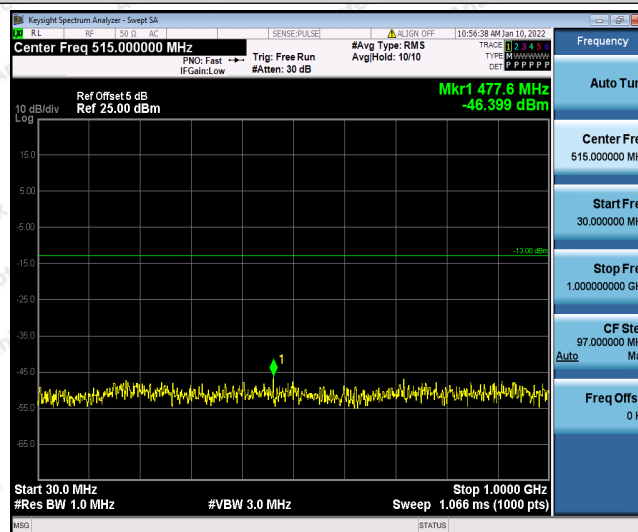


Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

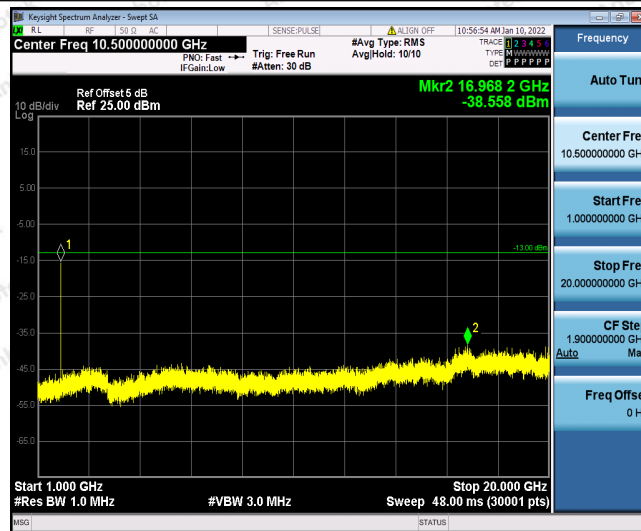

Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

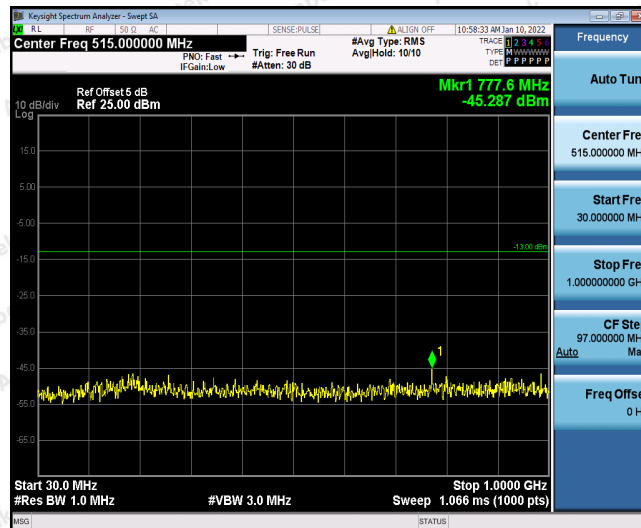

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

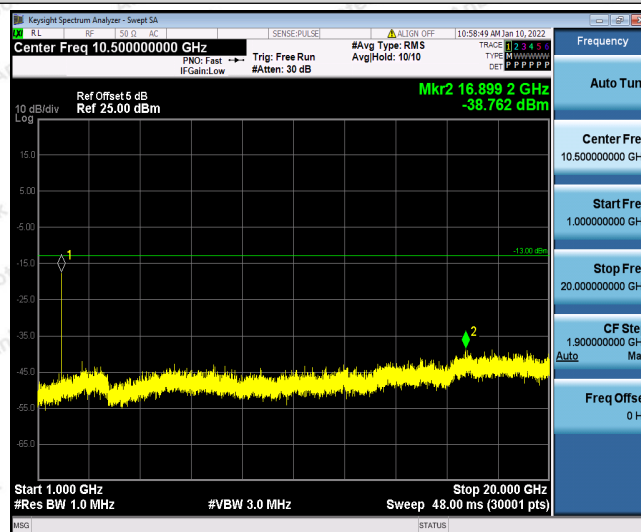

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.


Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com




Hotline

400-003-0500


www.anbotek.com

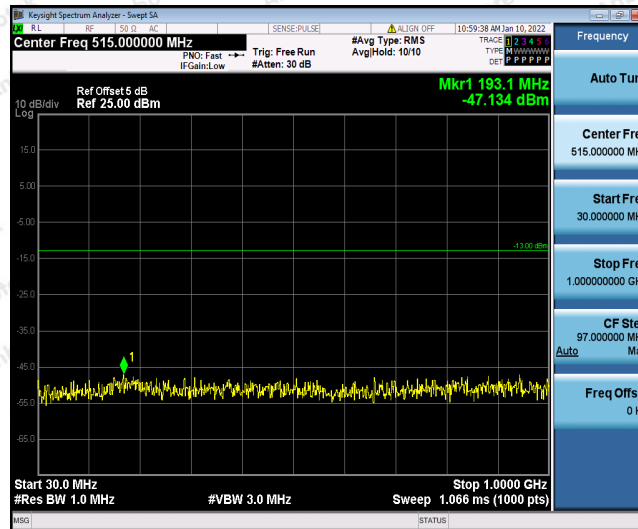

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz

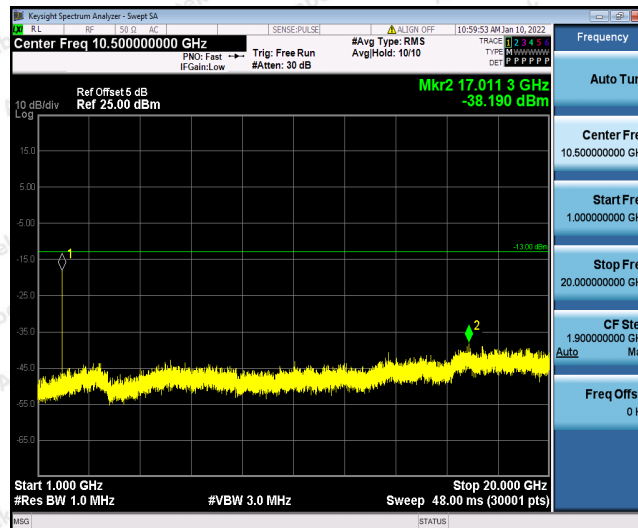

Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz

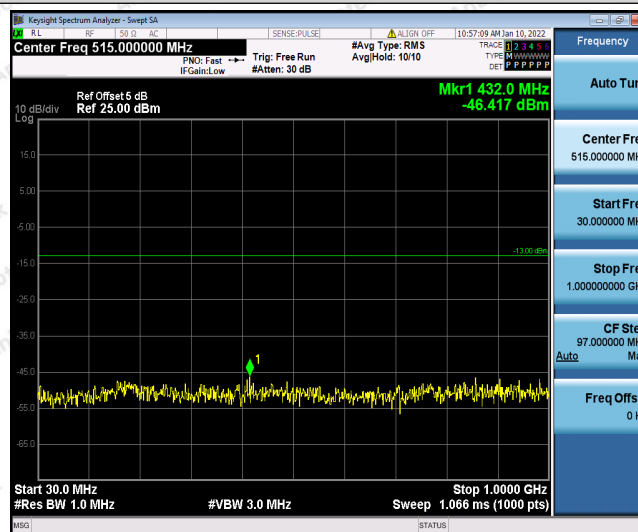


Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

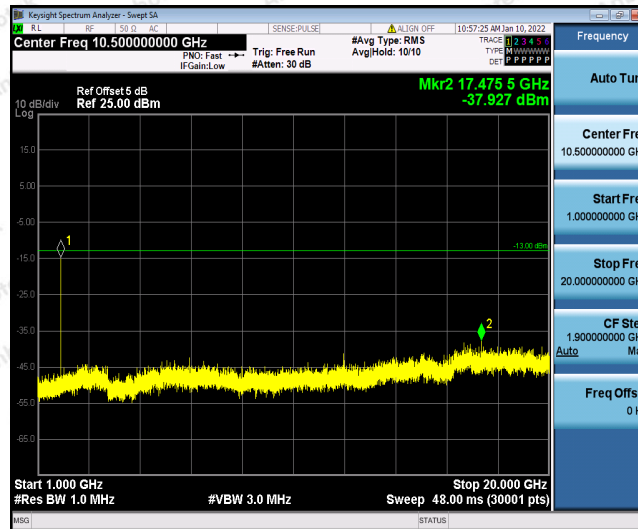

Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

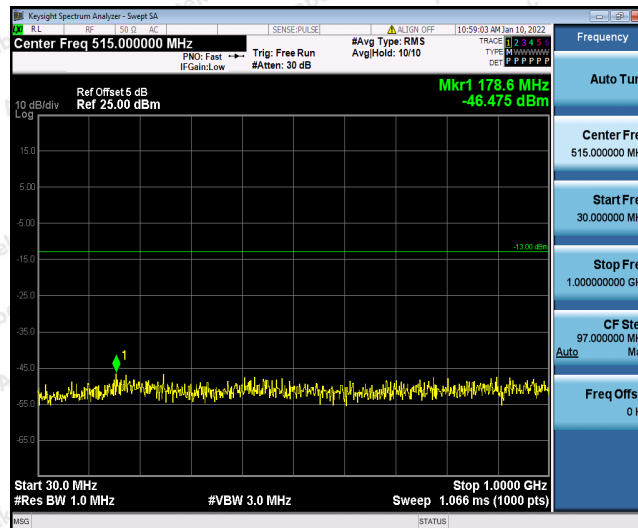

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

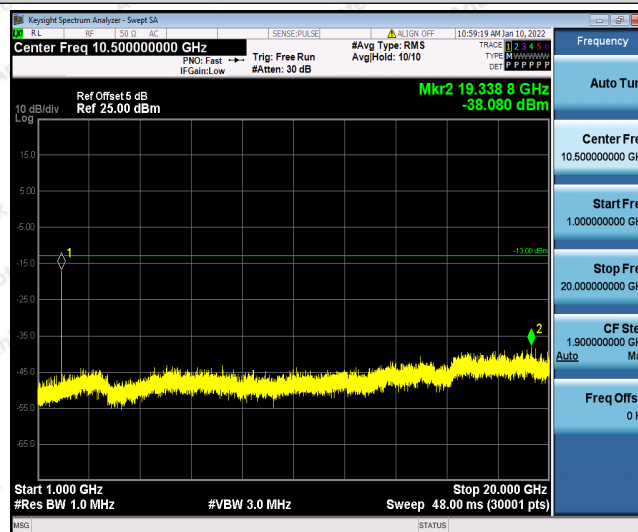


Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

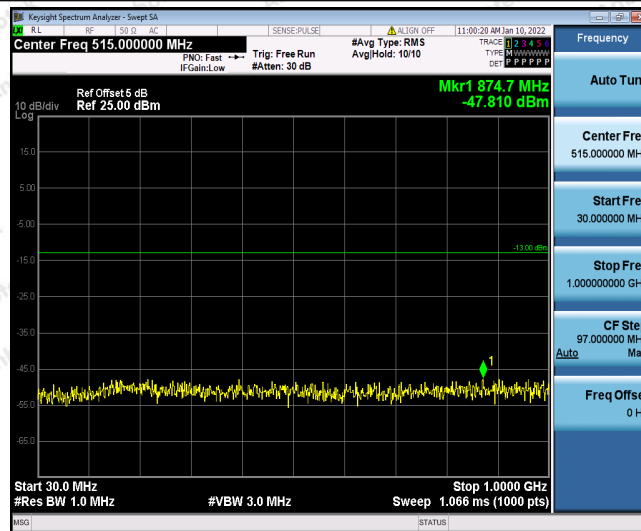

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

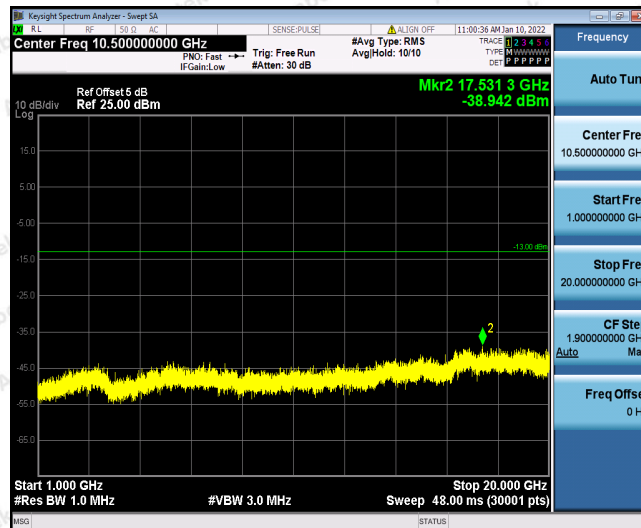

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz

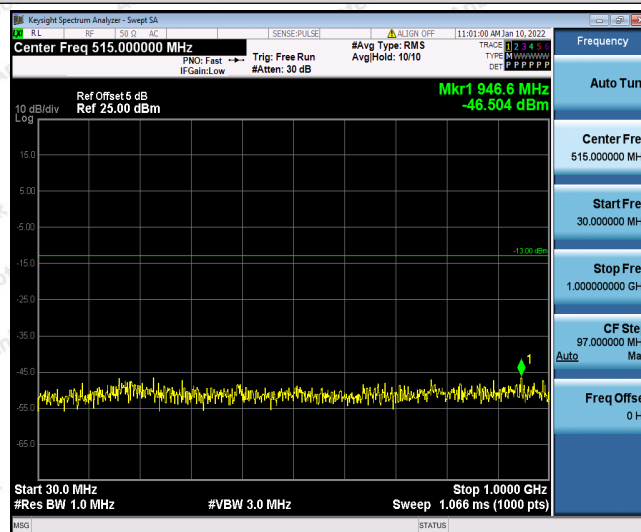


Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

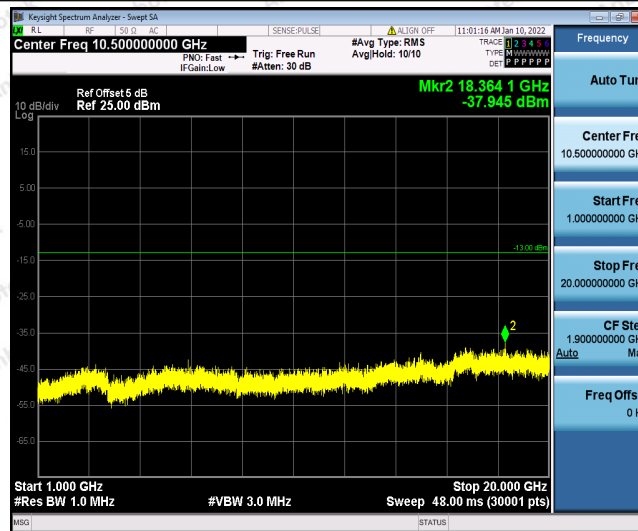

Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

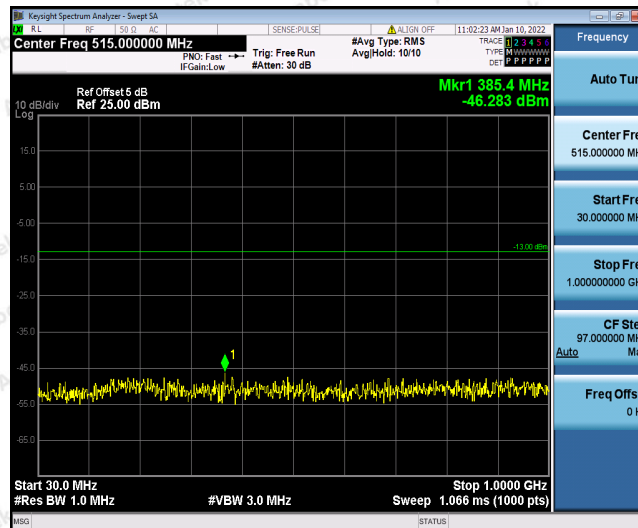

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

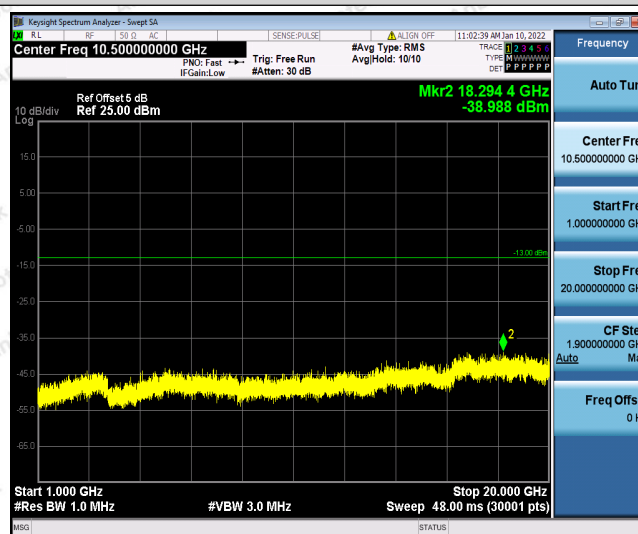


Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz

Shenzhen Anbotech Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

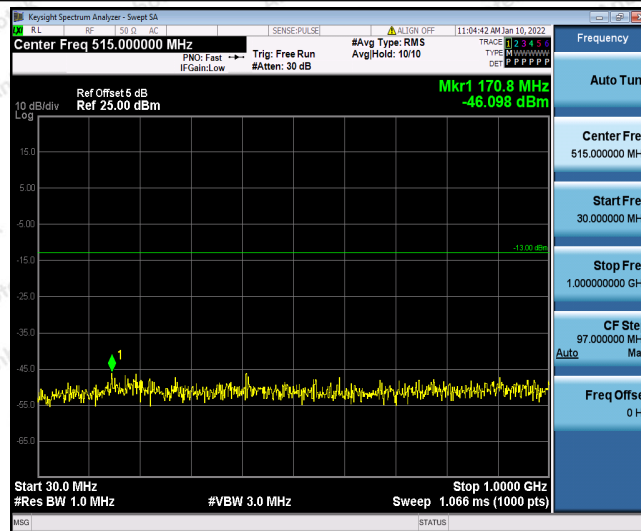

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

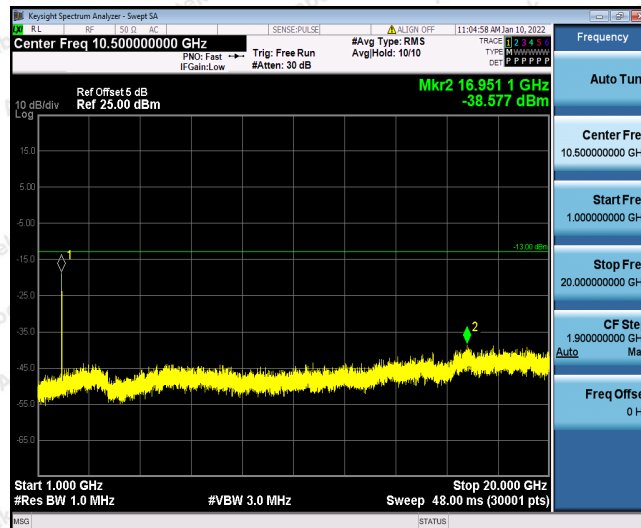

Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz

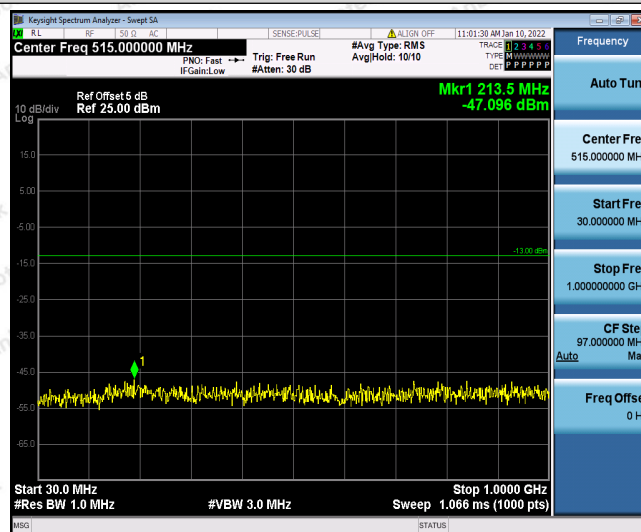


Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

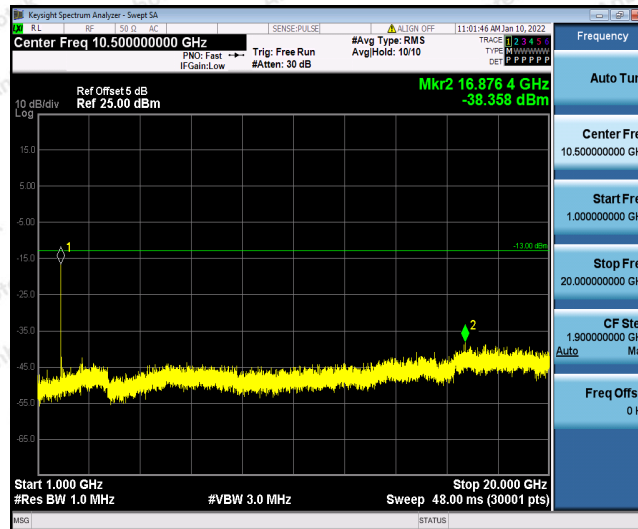

Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

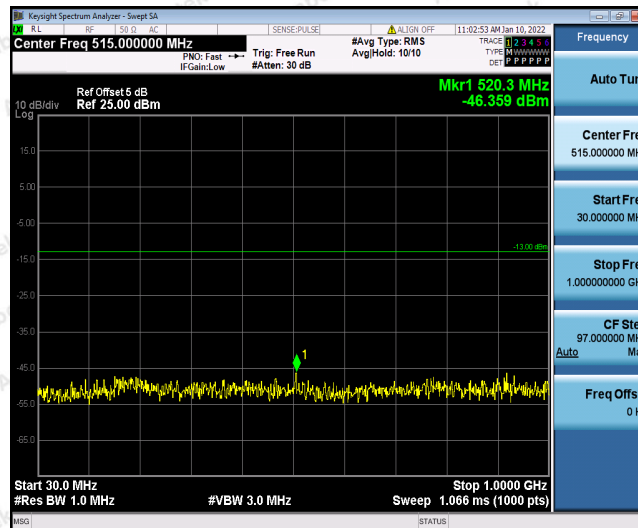

Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

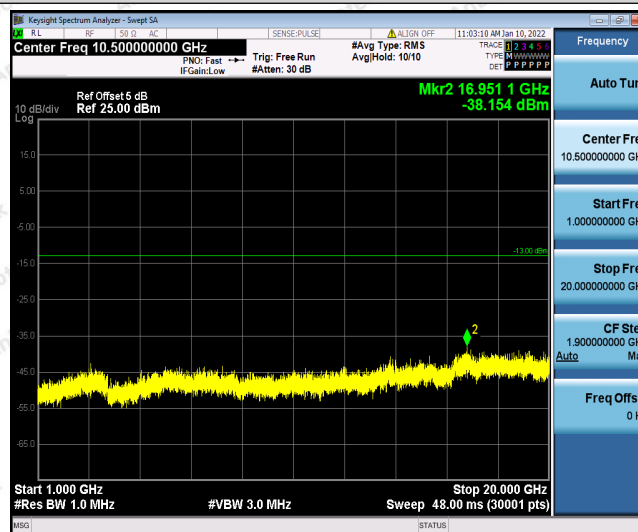


Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

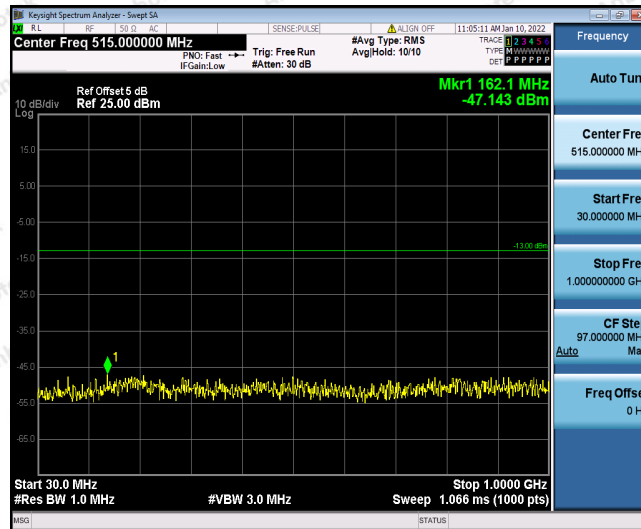

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz

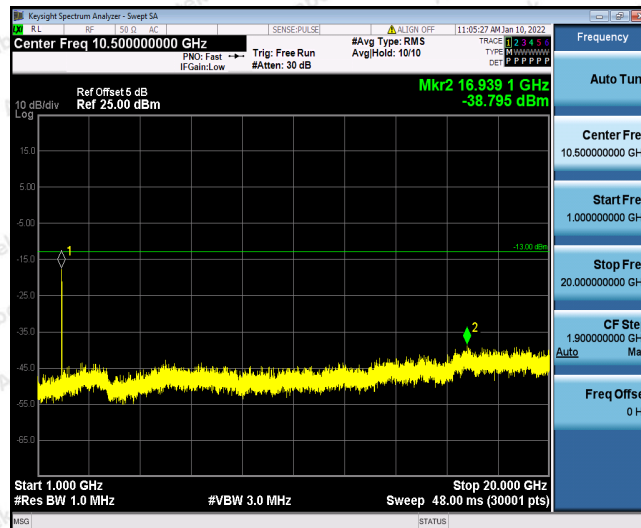

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

Appendix F: Frequency Stability VS Voltage

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-5.84	-0.003156	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-7.31	-0.003950	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-3.60	-0.001945	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-8.33	-0.004431	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-4.32	-0.002298	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-4.66	-0.002479	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-4.91	-0.002572	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-4.49	-0.002352	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-3.23	-0.001692	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-4.36	-0.002356	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-6.72	-0.003631	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-5.72	-0.003091	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-4.49	-0.002388	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-3.32	-0.001766	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-5.94	-0.003160	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-5.79	-0.003033	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-4.52	-0.002367	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	4.99	0.002614	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-6.27	-0.003386	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-6.17	-0.003332	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-4.43	-0.002393	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-4.78	-0.002543	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-5.12	-0.002723	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-6.12	-0.003255	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-2.56	-0.001341	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-3.28	-0.001719	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-5.01	-0.002625	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-6.34	-0.003424	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-8.00	-0.004321	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-3.58	-0.001934	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-5.74	-0.003053	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-6.17	-0.003282	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-5.41	-0.002878	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-2.85	-0.001493	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline

400-003-0500

www.anbotech.com

Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-4.51	-0.002363	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	1.87	0.000980	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-7.67	-0.004140	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-4.39	-0.002370	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-3.63	-0.001960	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-6.11	-0.003250	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-5.61	-0.002984	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-9.63	-0.005122	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-2.56	-0.001342	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-3.72	-0.001950	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	3.26	0.001709	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-6.39	-0.003449	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-4.69	-0.002532	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-4.75	-0.002564	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-7.52	-0.004000	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-5.78	-0.003074	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-3.22	-0.001713	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-5.69	-0.002983	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	4.31	0.002260	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-2.49	-0.001305	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-4.39	-0.002367	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-5.25	-0.002830	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-4.69	-0.002528	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-7.08	-0.003766	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-4.91	-0.002612	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-4.79	-0.002548	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-4.66	-0.002446	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	4.82	0.002530	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	4.78	0.002509	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-6.41	-0.003456	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-5.01	-0.002701	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-7.30	-0.003935	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-4.59	-0.002441	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-6.74	-0.003585	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-7.31	-0.003888	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	3.86	0.002026	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	-1.54	-0.000808	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	3.50	0.001837	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-7.02	-0.003779	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-7.00	-0.003769	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-8.04	-0.004328	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-5.39	-0.002867	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-7.60	-0.004043	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-6.92	-0.003681	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-7.32	-0.003848	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-8.01	-0.004210	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-6.68	-0.003511	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-7.91	-0.004258	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-4.69	-0.002525	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-6.12	-0.003295	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-7.48	-0.003979	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-6.05	-0.003218	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-5.71	-0.003037	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-7.14	-0.003753	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-7.98	-0.004194	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-6.28	-0.003301	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	4.19	0.002253	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	4.59	0.002468	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3.55	0.001909	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-7.52	-0.004000	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-5.52	-0.002936	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-6.39	-0.003399	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-6.18	-0.003253	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-6.72	-0.003537	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-6.39	-0.003363	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	4.82	0.002591	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	4.62	0.002484	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	5.58	0.003000	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-6.31	-0.003356	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-4.41	-0.002346	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-6.72	-0.003574	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-4.72	-0.002484	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-5.55	-0.002921	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-6.91	-0.003637	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com

AppendixG:Frequency Stability VS Temperature

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-5.71	-0.003085	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-5.82	-0.003145	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-7.82	-0.004225	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-5.24	-0.002831	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-7.25	-0.003917	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-4.29	-0.002282	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-7.61	-0.004048	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-5.11	-0.002718	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-6.98	-0.003713	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-6.32	-0.003362	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	2.46	0.001288	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	3.32	0.001739	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	3.30	0.001728	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	3.98	0.002085	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-4.59	-0.002404	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-5.76	-0.003112	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-6.01	-0.003247	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-5.78	-0.003123	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-3.00	-0.001621	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-3.29	-0.001778	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-8.25	-0.004388	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-6.92	-0.003681	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-4.98	-0.002649	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-7.08	-0.003766	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-7.85	-0.004176	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	2.80	0.001467	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-3.65	-0.001912	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-3.06	-0.001603	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	-3.79	-0.001985	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	3.33	0.001744	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-6.09	-0.003289	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-4.48	-0.002420	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-5.42	-0.002927	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-4.35	-0.002349	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-6.32	-0.003413	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-4.95	-0.002633	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-6.02	-0.003202	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-5.58	-0.002968	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-6.78	-0.003606	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-6.14	-0.003266	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	2.76	0.001446	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-3.15	-0.001651	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	3.36	0.001761	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	3.69	0.001933	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-3.29	-0.001724	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-4.18	-0.002258	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-5.52	-0.002981	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-6.27	-0.003386	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-8.96	-0.004839	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-4.61	-0.002490	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-6.15	-0.003271	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-5.52	-0.002936	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-6.31	-0.003356	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-8.57	-0.004559	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-6.59	-0.003505	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-2.62	-0.001373	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-3.62	-0.001897	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	-2.35	-0.001231	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-2.98	-0.001561	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	-3.00	-0.001572	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-4.66	-0.002516	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-4.69	-0.002532	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-4.99	-0.002694	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-8.13	-0.004389	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-7.18	-0.003876	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-6.11	-0.003250	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-6.82	-0.003628	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-6.28	-0.003340	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-5.26	-0.002798	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-5.66	-0.003011	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-4.11	-0.002155	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-3.38	-0.001772	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-4.65	-0.002438	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-4.21	-0.002207	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	3.56	0.001866	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-6.02	-0.003250	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-6.91	-0.003730	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-5.54	-0.002991	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-5.84	-0.003152	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-7.54	-0.004070	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-7.48	-0.003979	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-7.17	-0.003814	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-7.93	-0.004218	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-8.74	-0.004649	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-4.42	-0.002351	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-4.19	-0.002197	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-5.26	-0.002758	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-3.39	-0.001777	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	5.32	0.002789	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	-4.55	-0.002385	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-5.42	-0.002922	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-6.35	-0.003423	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-5.76	-0.003105	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-5.72	-0.003084	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-7.05	-0.003801	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-6.01	-0.003197	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-6.05	-0.003218	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-7.11	-0.003782	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-8.11	-0.004314	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-6.25	-0.003324	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	3.15	0.001654	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	4.43	0.002325	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	3.10	0.001627	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	3.52	0.001848	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-3.33	-0.001748	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-6.68	-0.003601	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-6.45	-0.003477	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-5.58	-0.003008	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-5.65	-0.003046	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-7.52	-0.004054	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-4.31	-0.002293	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-4.42	-0.002351	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-8.77	-0.004665	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-8.01	-0.004261	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-6.35	-0.003378	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	4.86	0.002551	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	4.88	0.002562	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	10MHz	16QAM	19150	50RB#0	NV	0	3.83	0.002010	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	4.23	0.002220	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	2.85	0.001496	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-6.47	-0.003483	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-5.65	-0.003042	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-7.38	-0.003973	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-9.06	-0.004878	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-8.98	-0.004834	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-6.14	-0.003266	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-4.08	-0.002170	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-4.79	-0.002548	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-5.79	-0.003080	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-7.14	-0.003798	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-8.30	-0.004363	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-7.37	-0.003874	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-8.20	-0.004310	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-5.82	-0.003059	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-6.27	-0.003296	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-7.80	-0.004199	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-6.27	-0.003376	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-5.02	-0.002703	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-5.99	-0.003225	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-5.14	-0.002767	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-5.41	-0.002878	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-5.38	-0.002862	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-5.61	-0.002984	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-7.37	-0.003920	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-6.39	-0.003399	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-7.52	-0.003953	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-5.56	-0.002922	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-6.92	-0.003637	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-7.28	-0.003827	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-8.53	-0.004484	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	6.47	0.003478	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	3.82	0.002054	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	5.25	0.002823	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	4.31	0.002317	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	3.22	0.001731	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-6.49	-0.003452	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-5.49	-0.002920	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-6.98	-0.003713	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 755-26066440 Fax: (86) 755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com

Band2	20MHz	QPSK	18900	100RB#0	NV	10	-6.05	-0.003218	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-6.27	-0.003335	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-8.96	-0.004716	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-6.62	-0.003484	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-4.29	-0.002258	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-4.95	-0.002605	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-5.18	-0.002726	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	3.83	0.002059	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	3.62	0.001946	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	3.65	0.001962	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	5.41	0.002909	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	4.89	0.002629	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-7.93	-0.004218	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-6.94	-0.003691	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-7.00	-0.003723	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-7.45	-0.003963	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-6.82	-0.003628	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-7.38	-0.003884	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-3.49	-0.001837	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-6.95	-0.003658	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-5.58	-0.002937	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-6.65	-0.003500	±2.5	PASS

---End---