

Appendix Test Data

Report No.:	1821C50002812504	Test Sample No.:	1-2-2
Start Test Date:	2025.03.17	Finish Test Date:	2025.03.19
Test Engineer:	Hu Sen Guan	Auditor:	Justin Feng
Temperature:	21.3°C	Relative Humidity:	43%
Pressure:	101kPa		
Test module:	MT6631		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	19.52	5170.08	5189.60	---	---
11A	Ant1	5200	19.44	5190.20	5209.64	---	---
11A	Ant1	5240	19.40	5230.36	5249.76	---	---
11A	Ant1	5745	19.68	5735.16	5754.84	---	---
11A	Ant1	5785	19.56	5775.24	5794.80	---	---
11A	Ant1	5825	19.40	5815.32	5834.72	---	---
11N20SISO	Ant1	5180	19.84	5170.12	5189.96	---	---
11N20SISO	Ant1	5200	19.92	5190.00	5209.92	---	---
11N20SISO	Ant1	5240	20.20	5229.92	5250.12	---	---
11N20SISO	Ant1	5745	20.28	5734.72	5755.00	---	---
11N20SISO	Ant1	5785	20.24	5775.00	5795.24	---	---
11N20SISO	Ant1	5825	20.12	5814.96	5835.08	---	---
11N40SISO	Ant1	5190	40.32	5169.92	5210.24	---	---
11N40SISO	Ant1	5230	40.72	5209.52	5250.24	---	---
11N40SISO	Ant1	5755	40.32	5734.68	5775.00	---	---
11N40SISO	Ant1	5795	40.08	5774.92	5815.00	---	---
11AC20SISO	Ant1	5180	19.84	5170.12	5189.96	---	---
11AC20SISO	Ant1	5200	20.12	5189.92	5210.04	---	---
11AC20SISO	Ant1	5240	20.00	5229.96	5249.96	---	---
11AC20SISO	Ant1	5745	20.04	5735.08	5755.12	---	---
11AC20SISO	Ant1	5785	19.84	5775.08	5794.92	---	---
11AC20SISO	Ant1	5825	19.92	5815.08	5835.00	---	---

Shenzhen Anbotech Compliance Laboratory Limited

11AC40SISO	Ant1	5190	39.92	5169.60	5209.52	---	---
11AC40SISO	Ant1	5230	40.72	5209.76	5250.48	---	---
11AC40SISO	Ant1	5755	40.64	5734.76	5775.40	---	---
11AC40SISO	Ant1	5795	39.92	5775.08	5815.00	---	---
11AC80SISO	Ant1	5210	79.68	5170.16	5249.84	---	---
11AC80SISO	Ant1	5775	80.32	5734.68	5815.00	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com




Hotline
400-003-0500
www.anbotek.com


Test Graphs

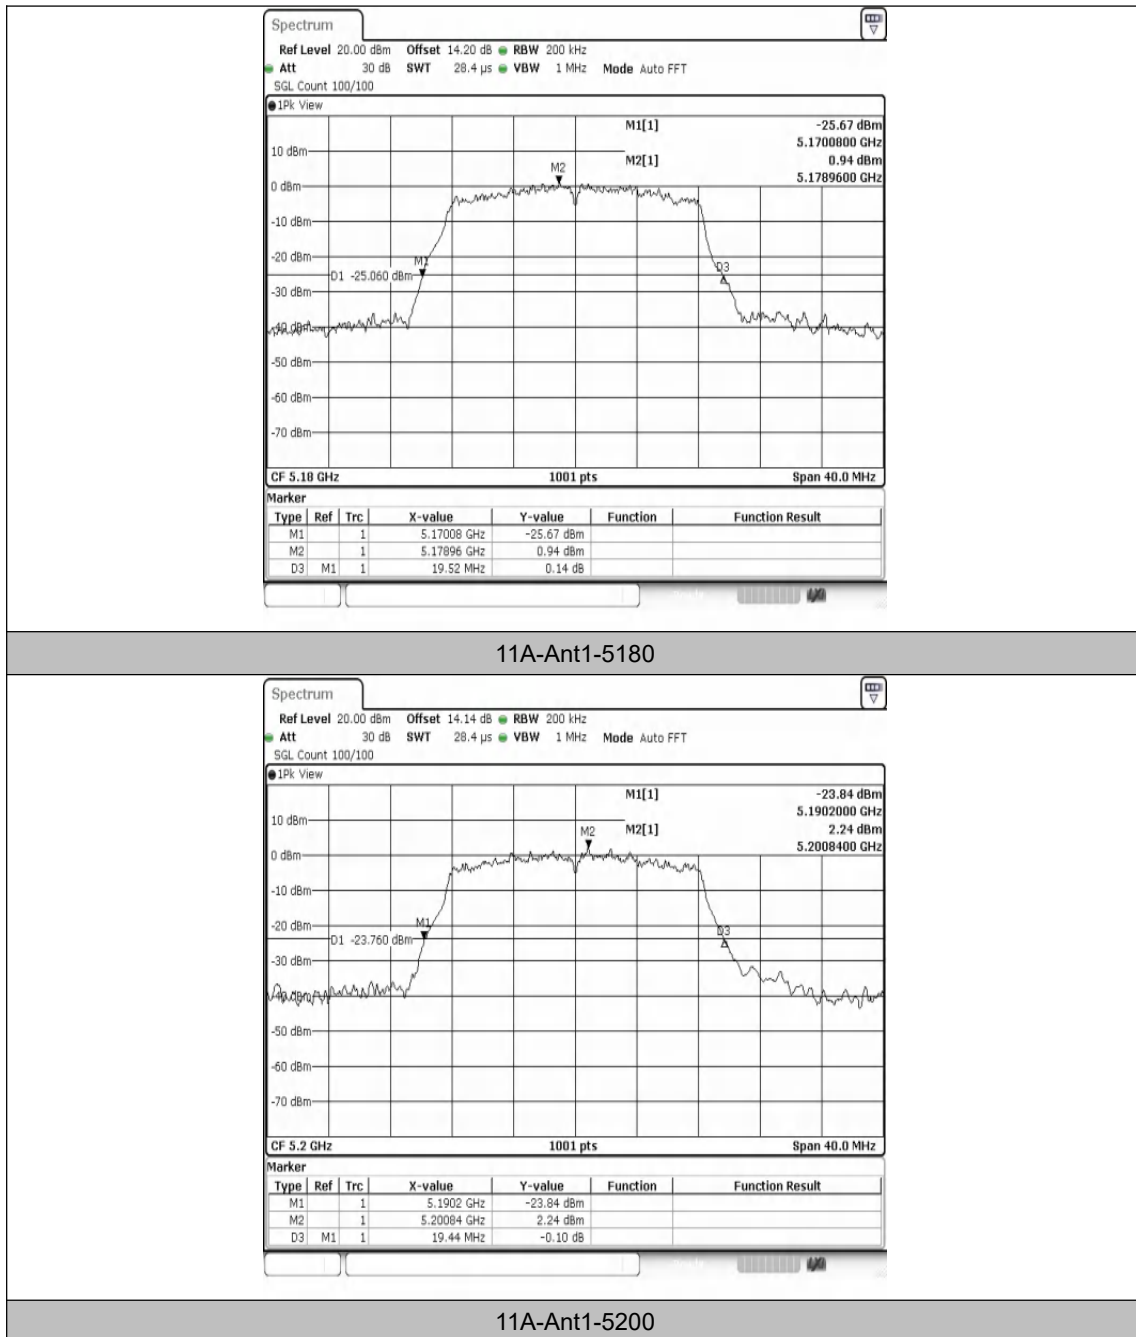

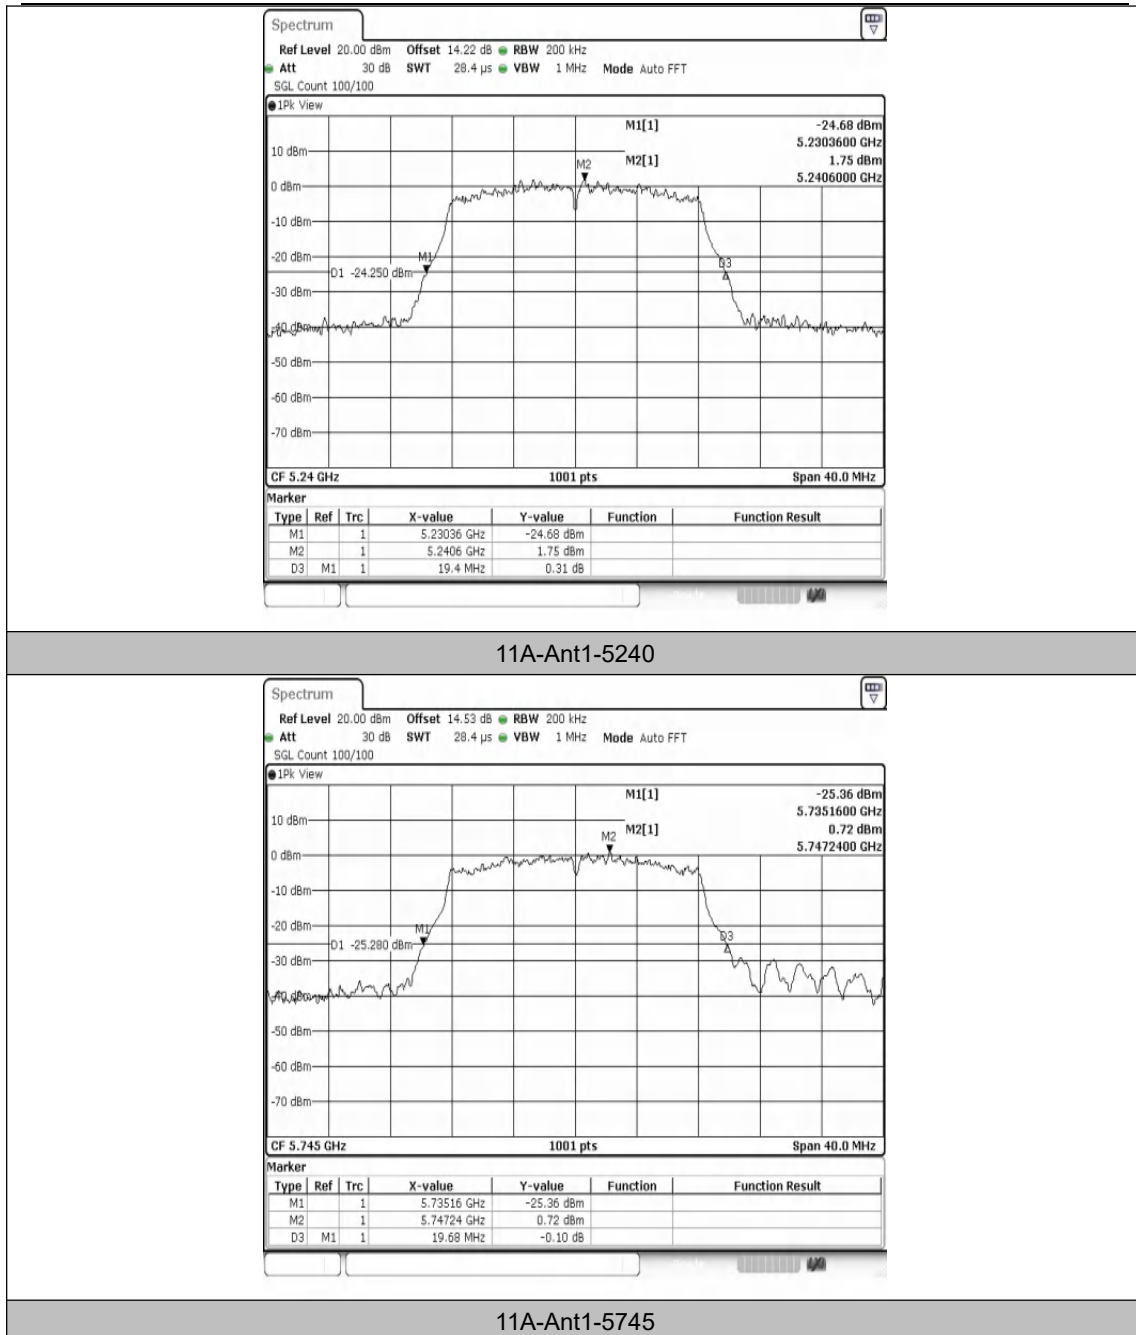


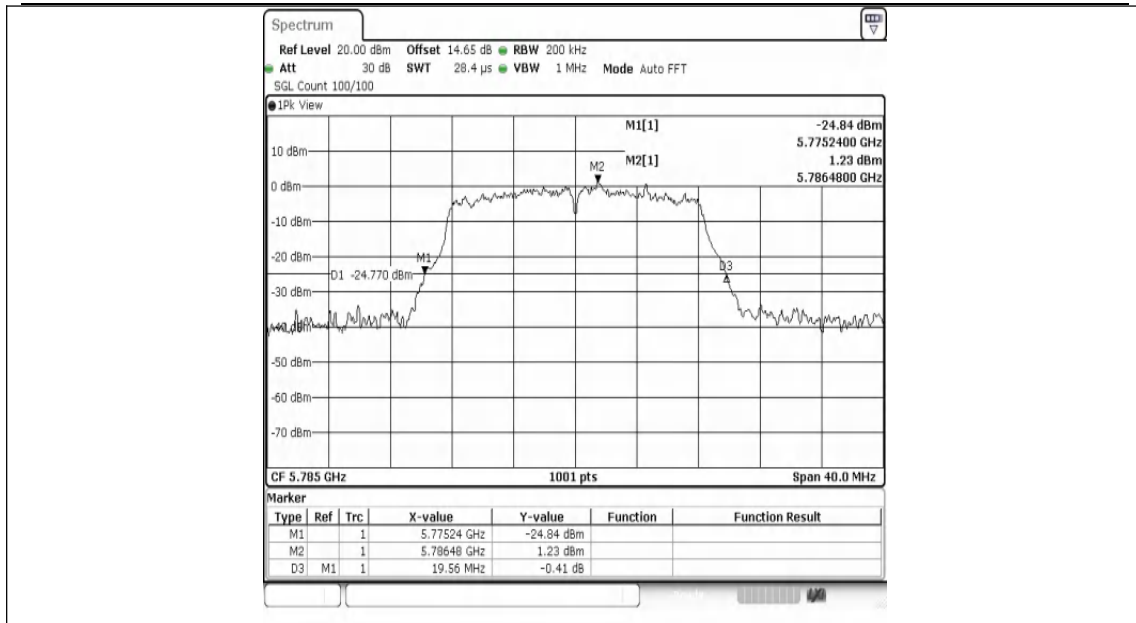



11A-Ant1-5785

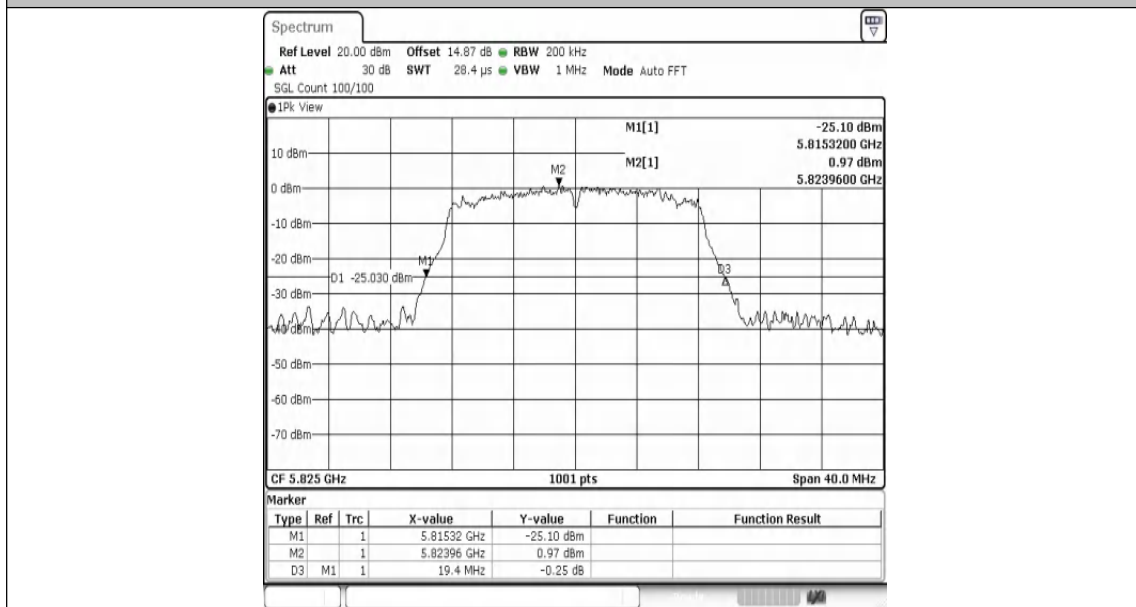



11A-Ant1-5825

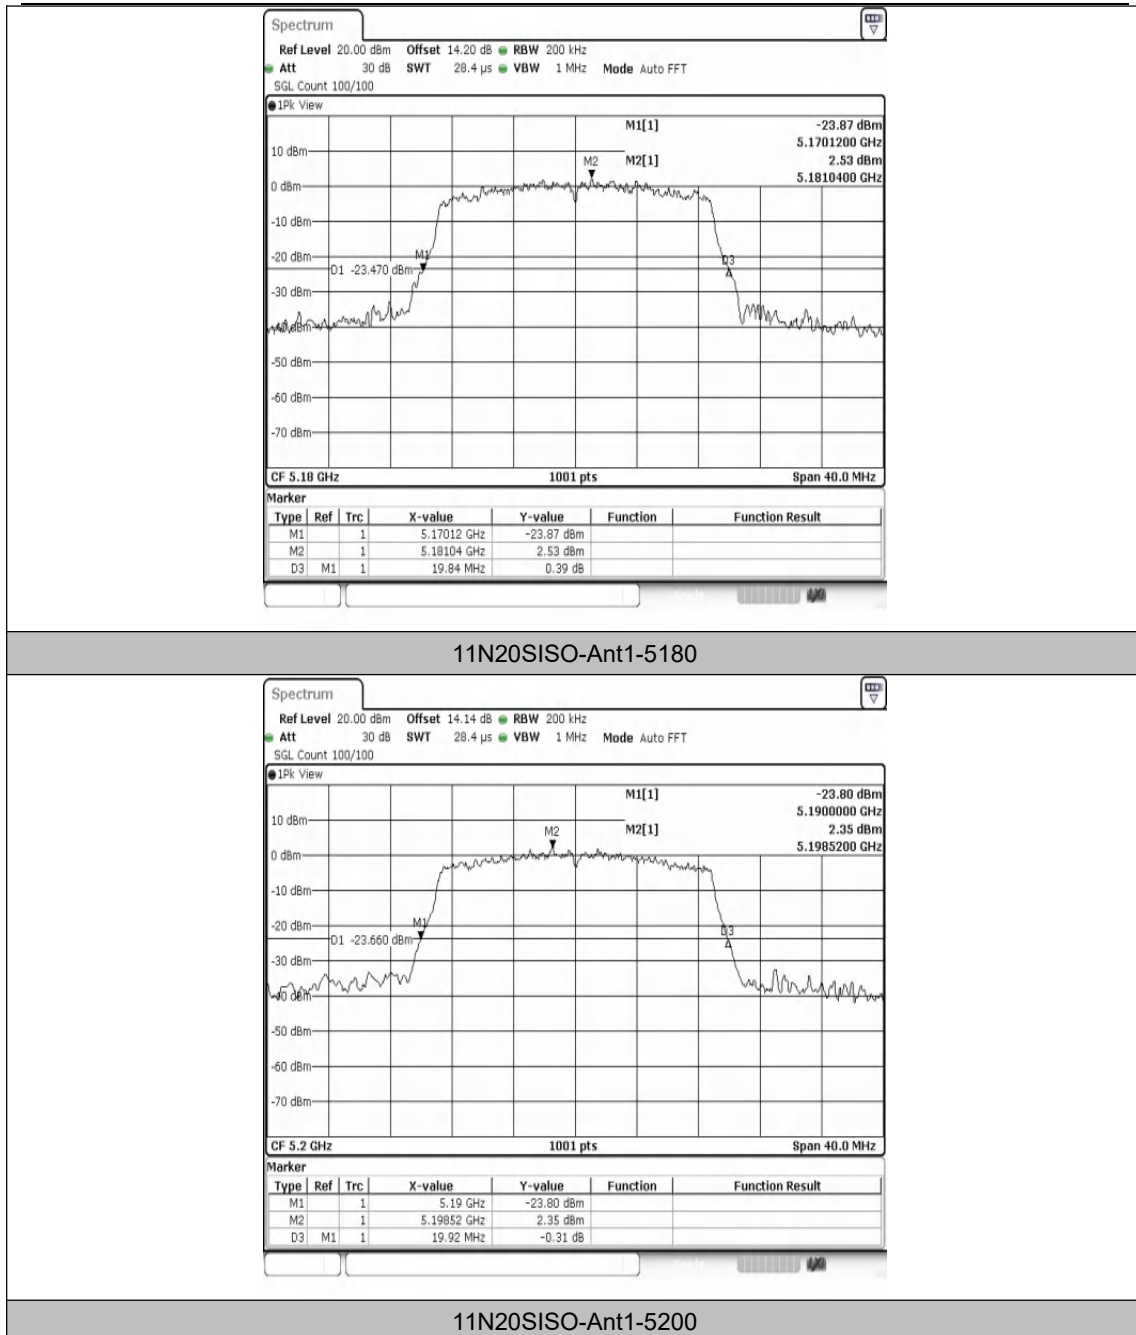

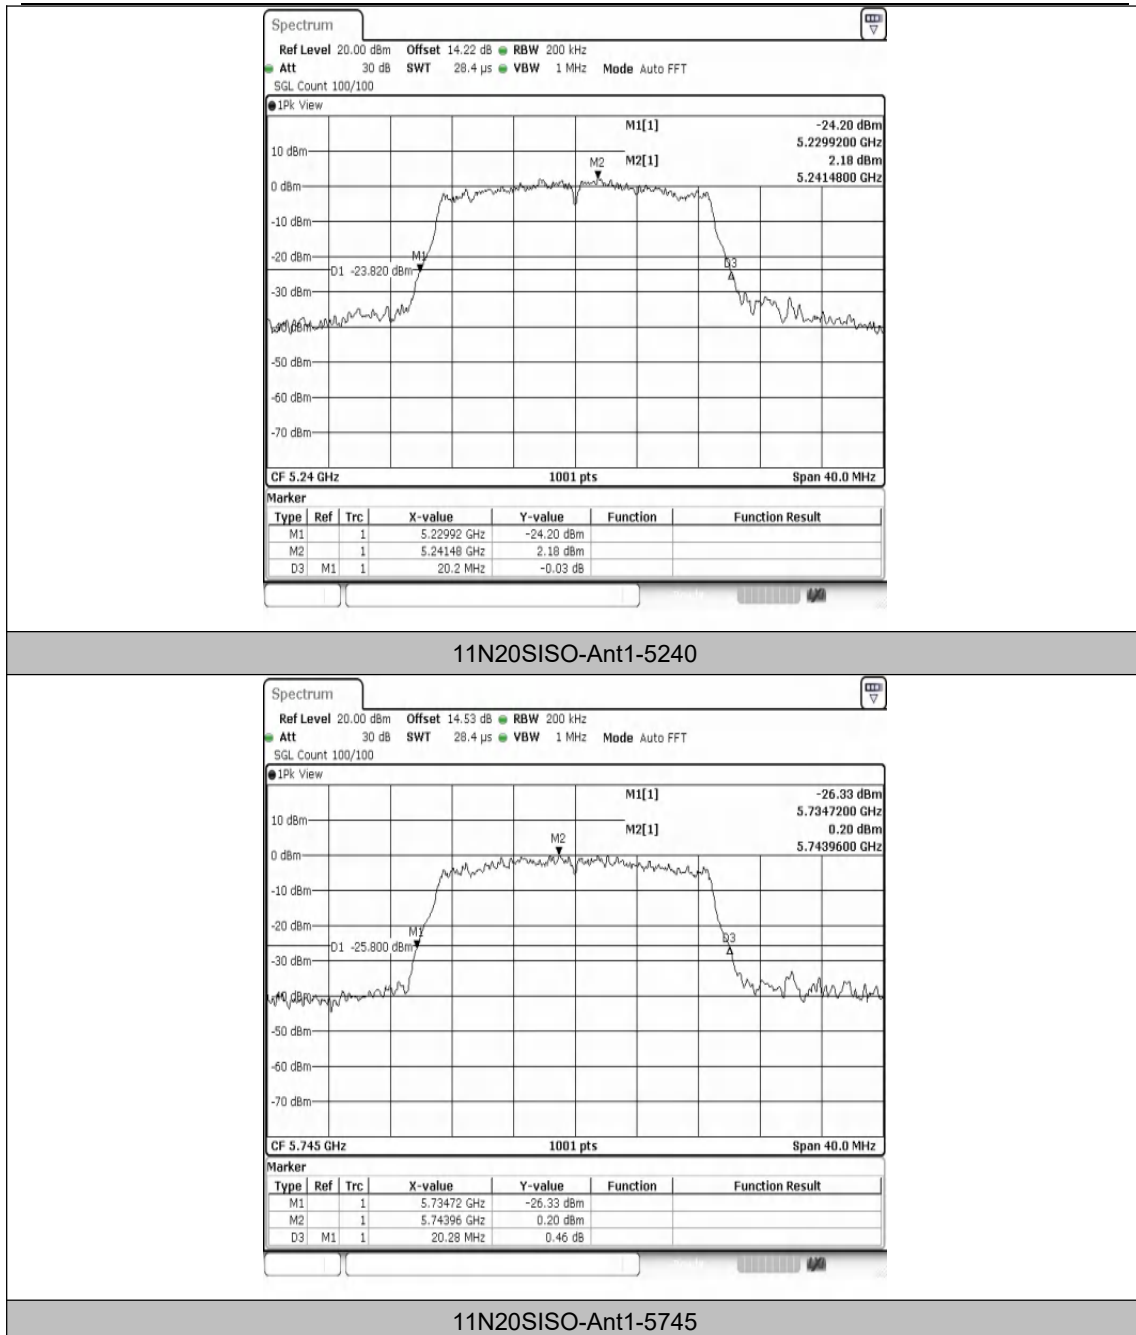


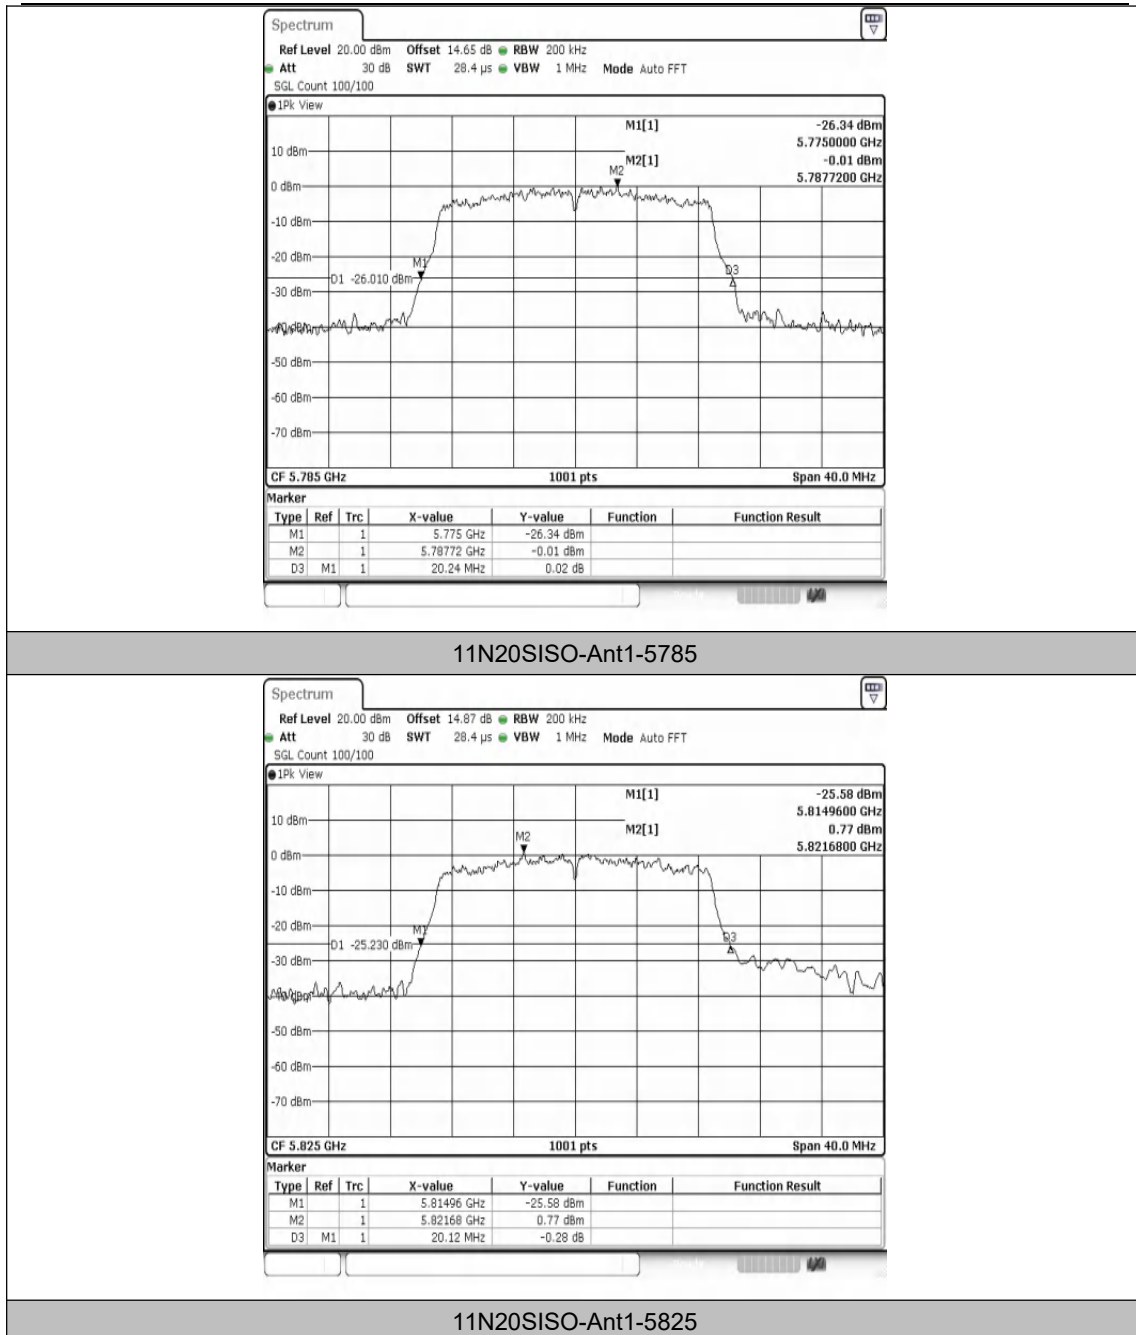

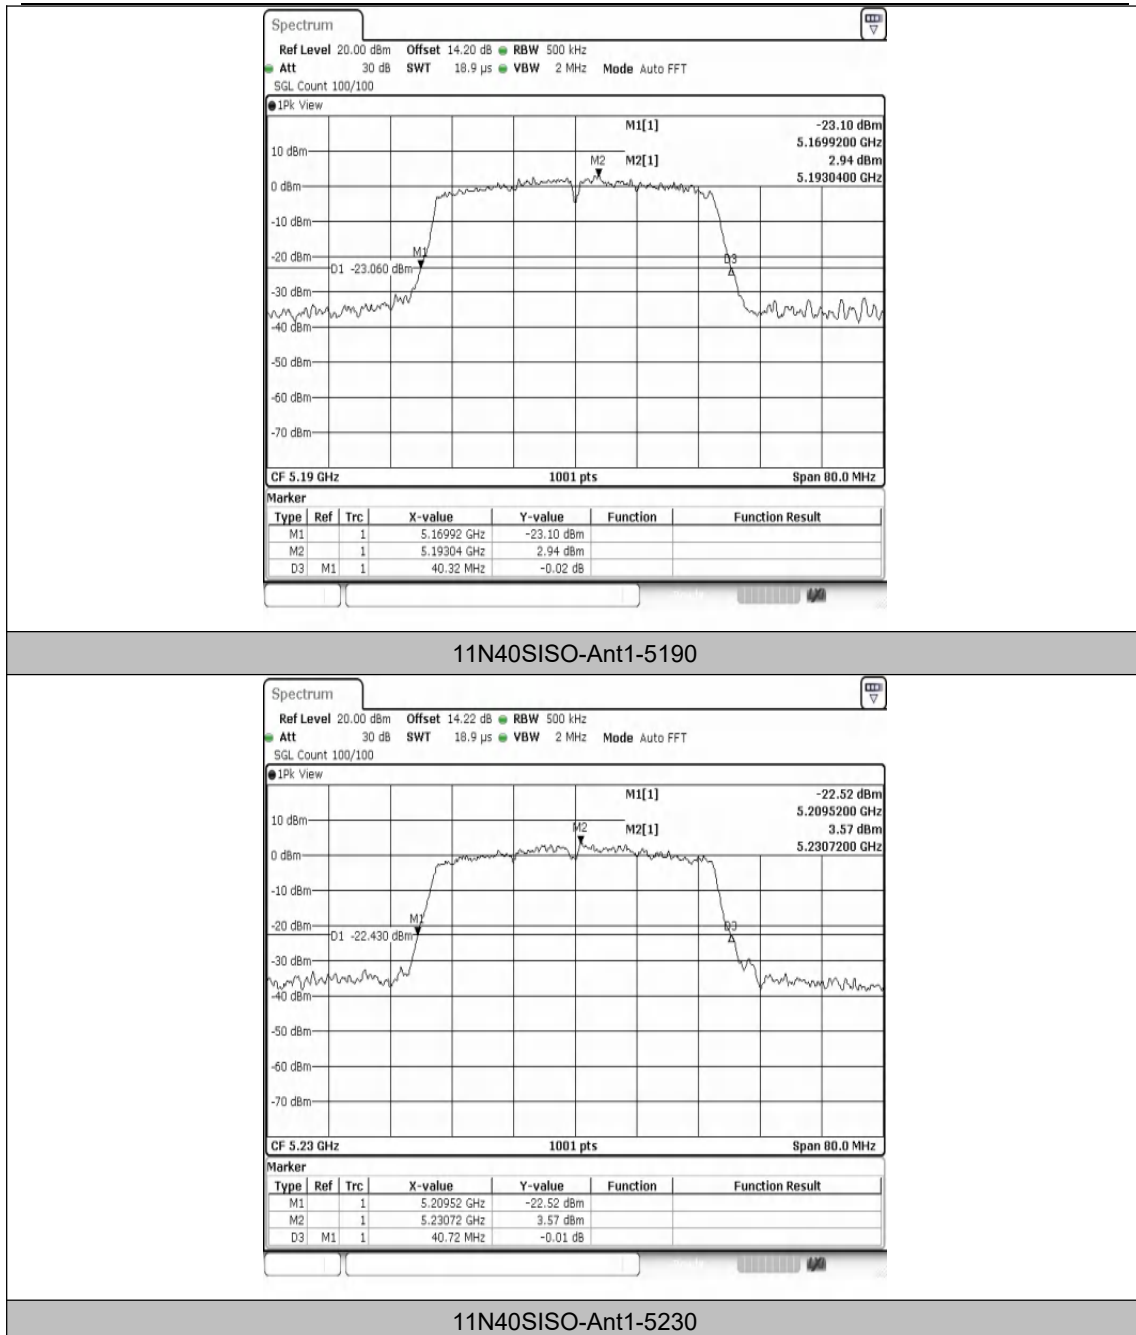


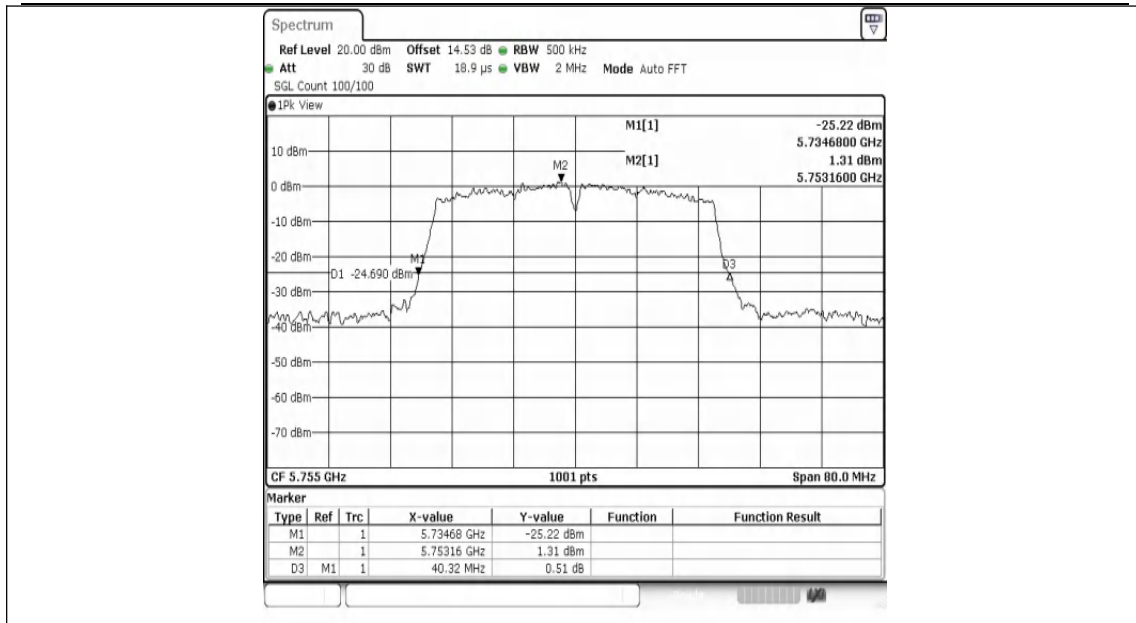


11N40SISO-Ant1-5755

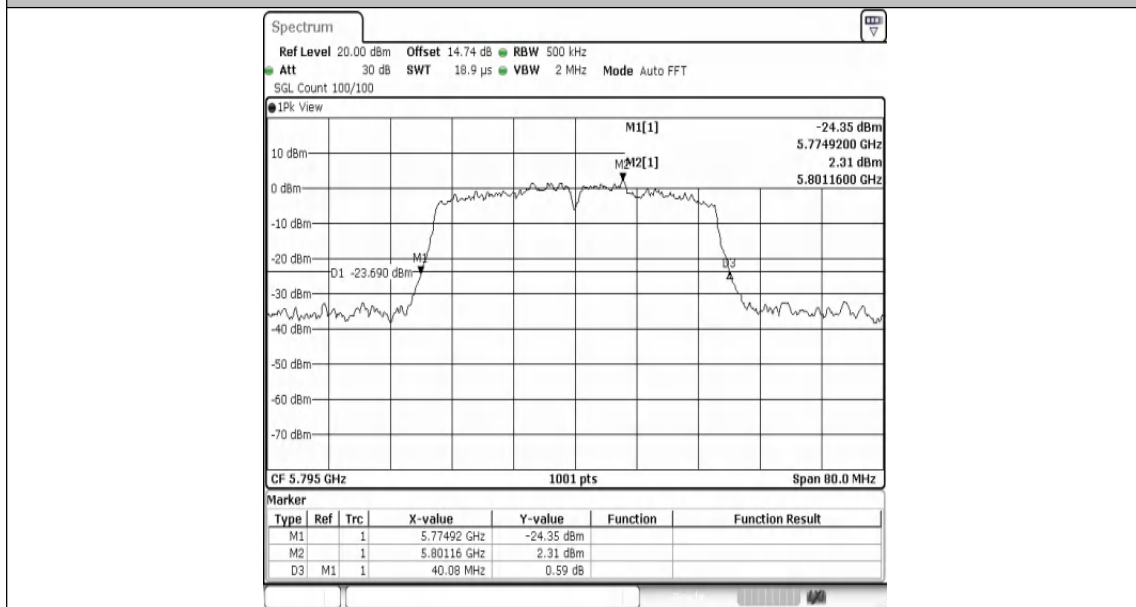


11N40SISO-Ant1-5795

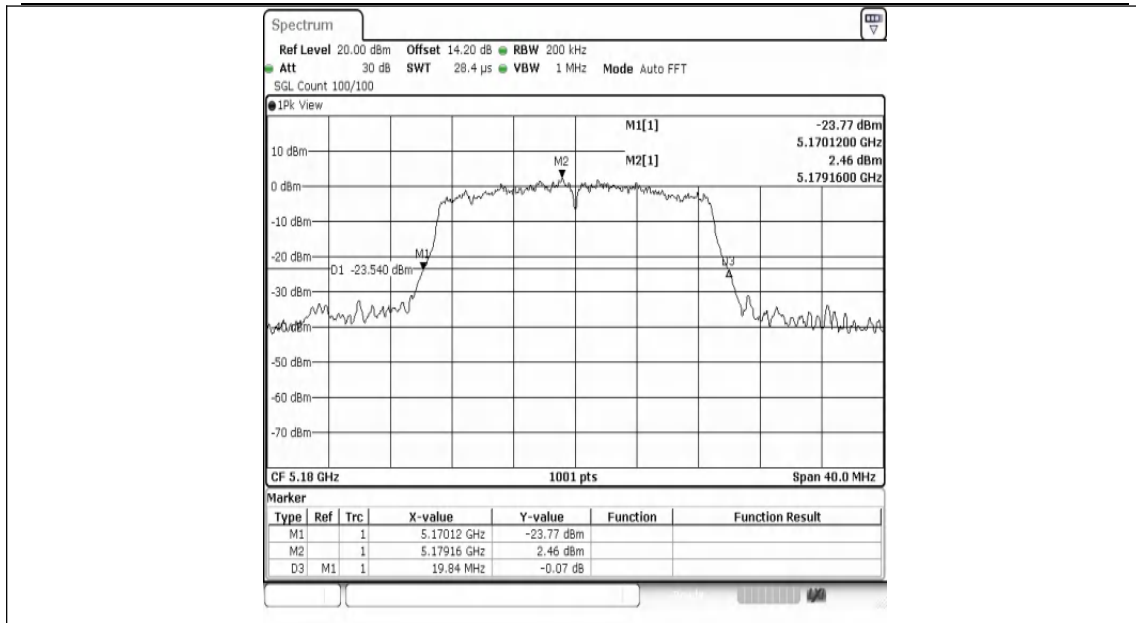


11AC20SISO-Ant1-5180

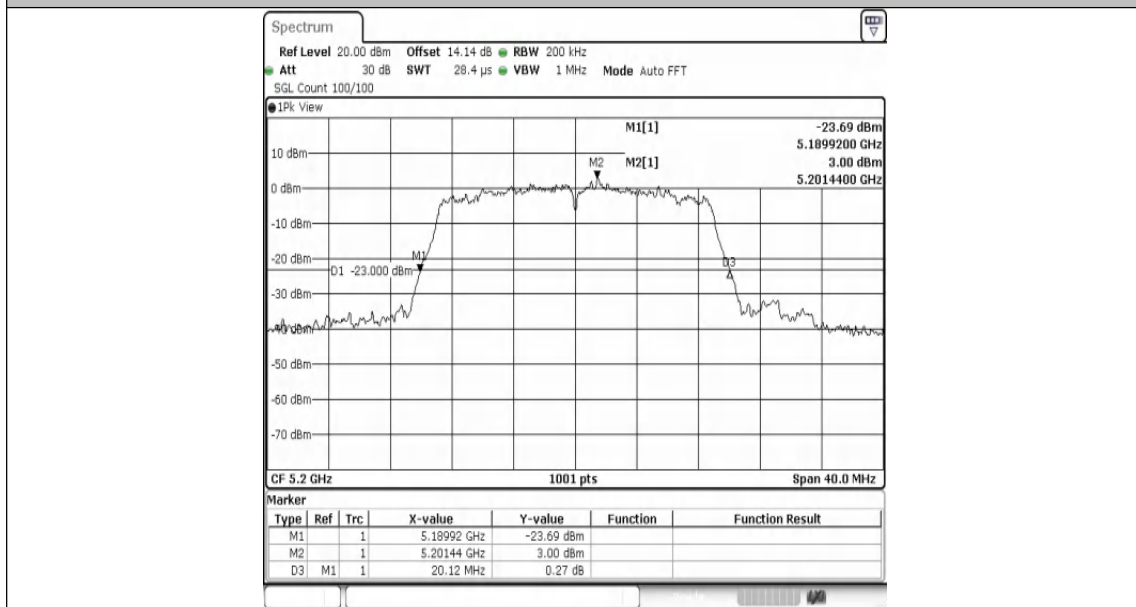

11AC20SISO-Ant1-5200

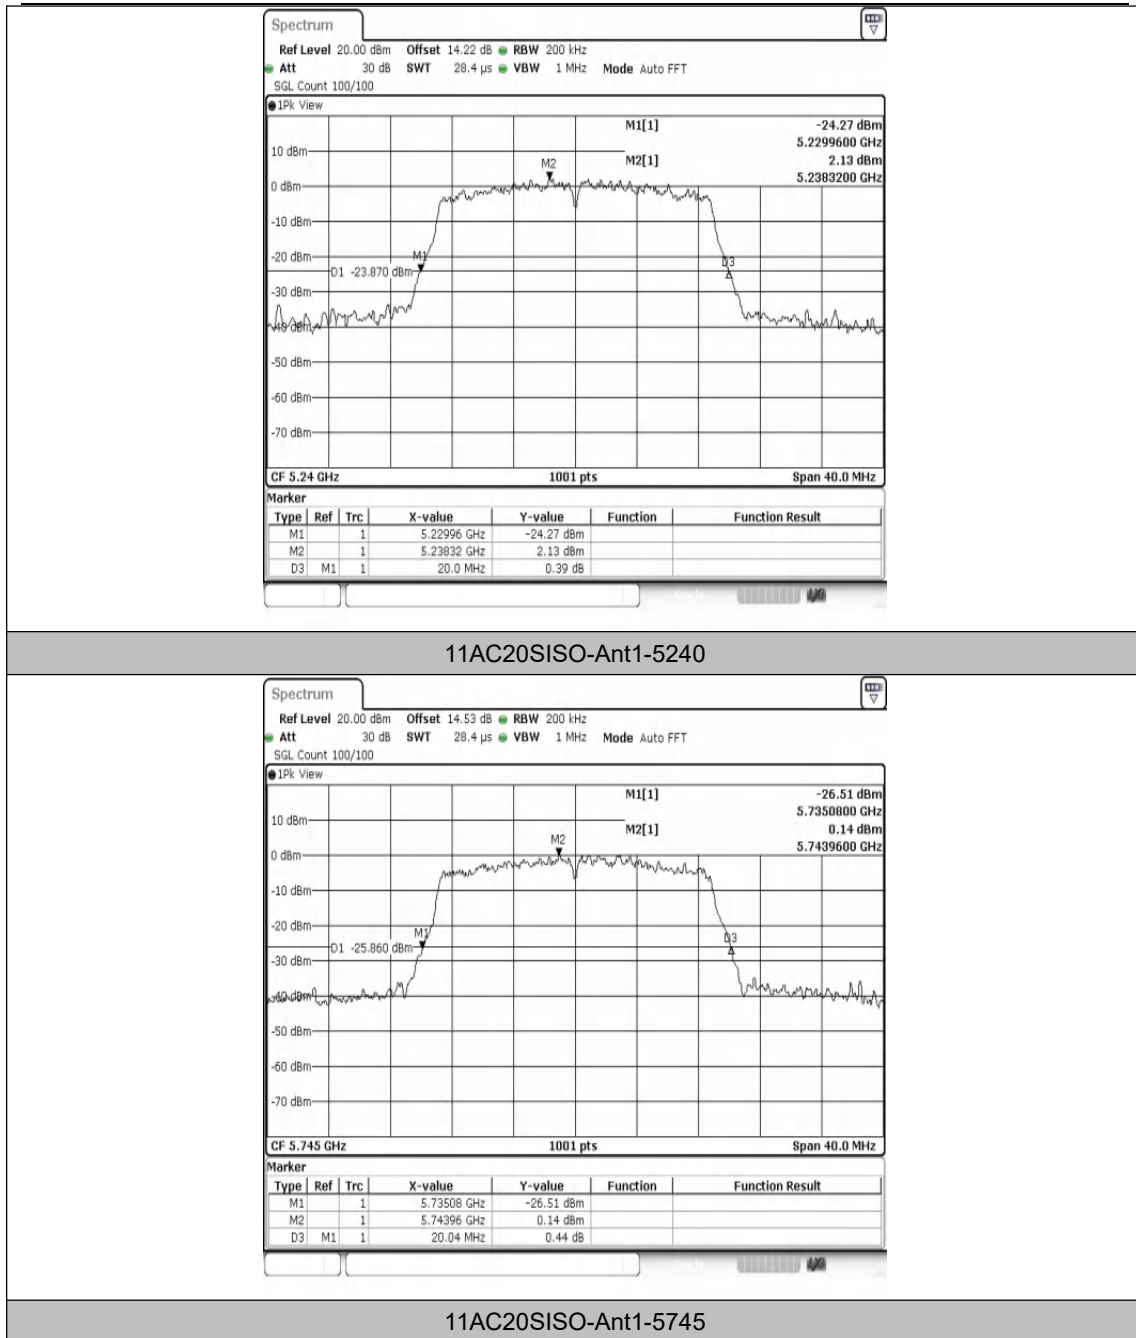


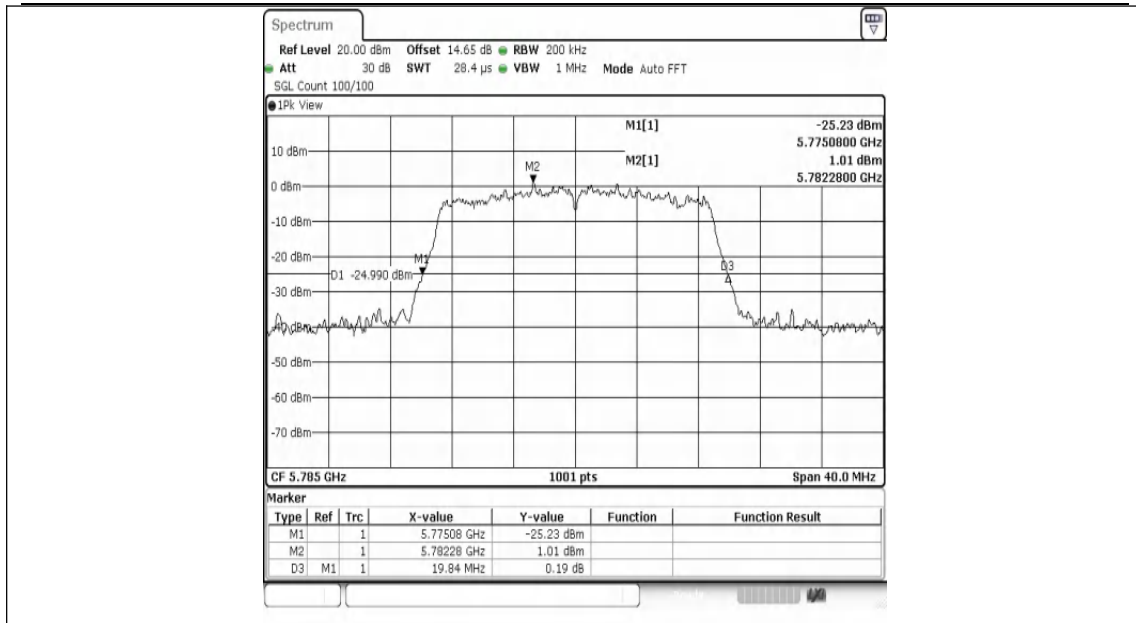


11AC20SISO-Ant1-5785




11AC20SISO-Ant1-5825

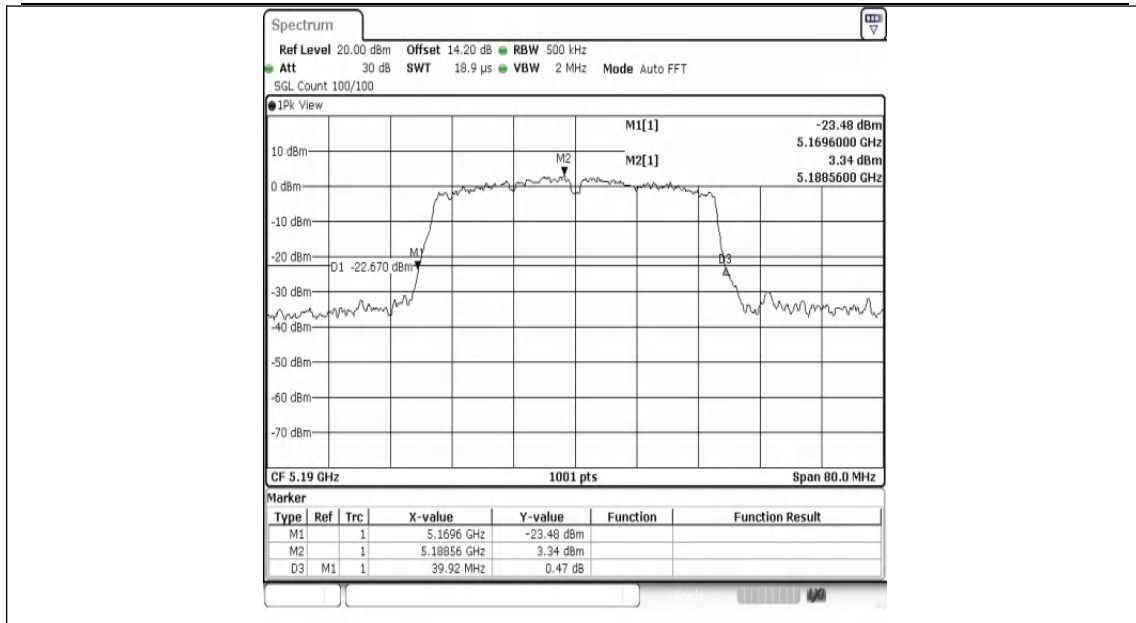


11AC40SISO-Ant1-5190

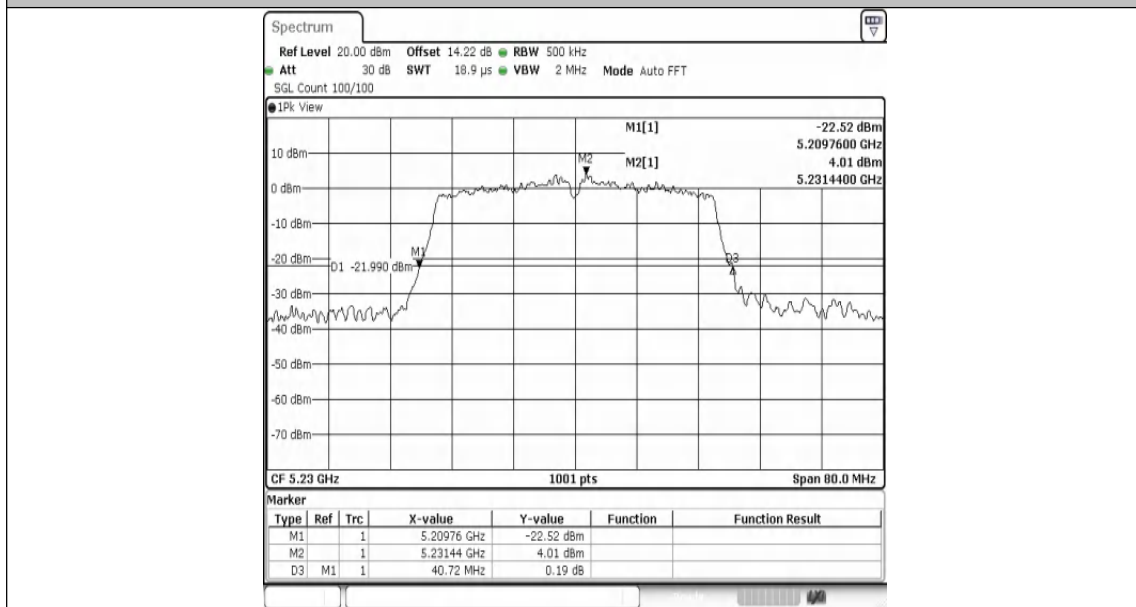


11AC40SISO-Ant1-5230

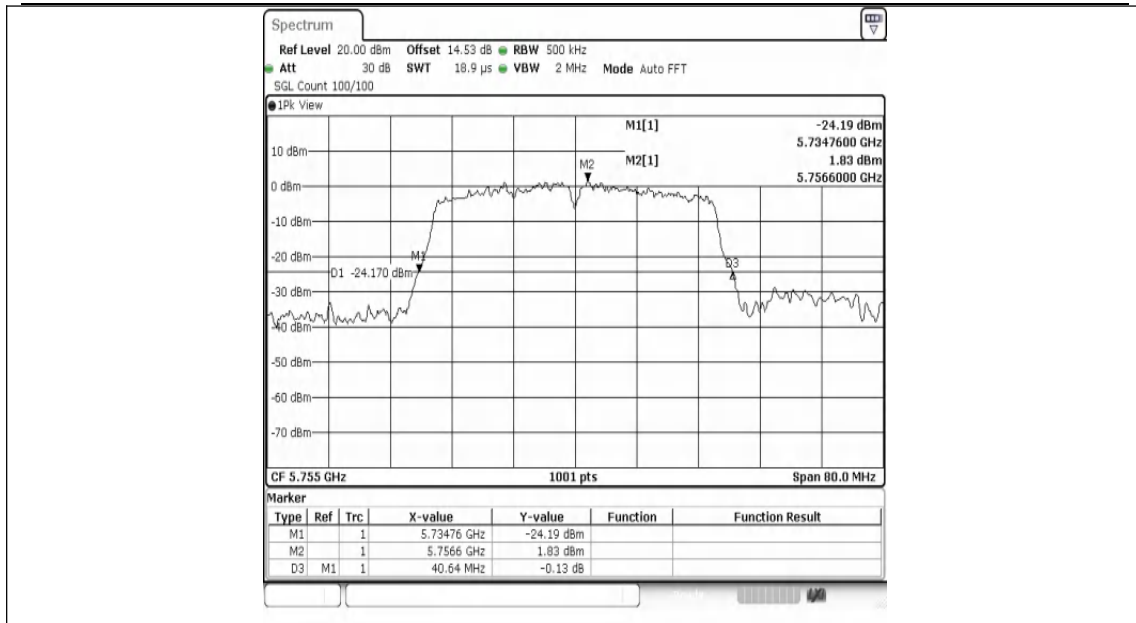

11AC40SISO-Ant1-5755

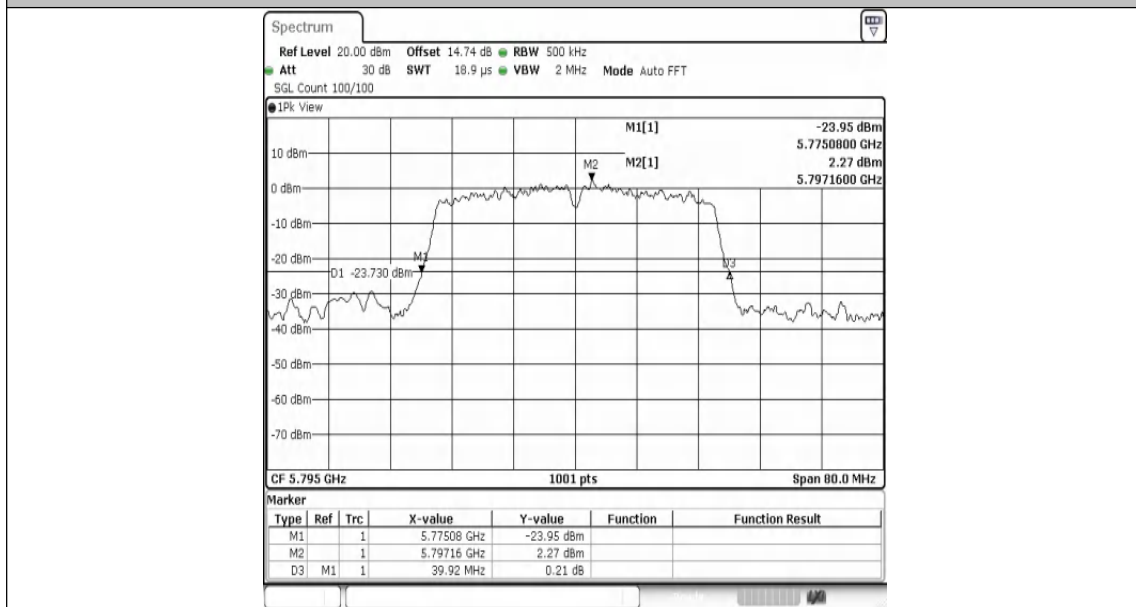

11AC40SISO-Ant1-5795

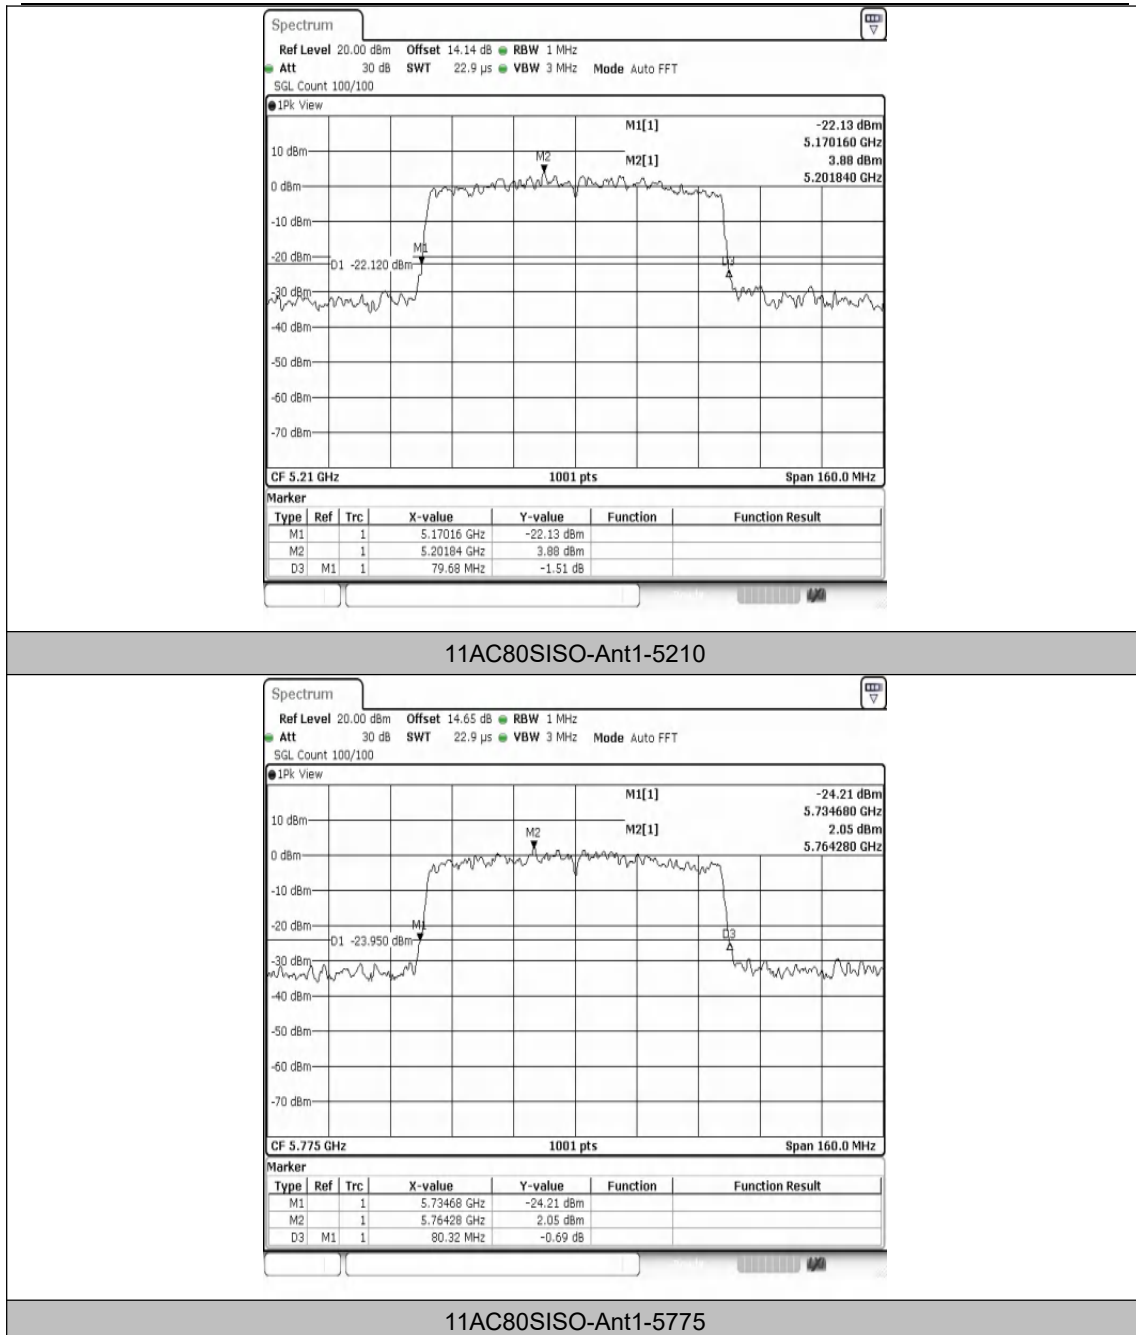



Appendix A2: 99% Occupied Bandwidth

Test Result


Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.903	5171.6084	5188.5115	---	---
11A	Ant1	5200	16.983	5191.5684	5208.5514	---	---
11A	Ant1	5240	17.063	5231.4486	5248.5115	---	---
11A	Ant1	5745	16.823	5736.5285	5753.3516	---	---
11A	Ant1	5785	17.383	5776.2488	5793.6314	---	---
11A	Ant1	5825	16.943	5816.6084	5833.5514	---	---
11N20SISO	Ant1	5180	18.062	5171.0090	5189.0709	---	---
11N20SISO	Ant1	5200	17.942	5191.1289	5209.0709	---	---
11N20SISO	Ant1	5240	17.942	5231.0889	5249.0310	---	---
11N20SISO	Ant1	5745	17.862	5736.1688	5754.0310	---	---
11N20SISO	Ant1	5785	17.862	5776.0490	5793.9111	---	---
11N20SISO	Ant1	5825	17.902	5816.1289	5834.0310	---	---
11N40SISO	Ant1	5190	36.124	5172.0180	5208.1419	---	---
11N40SISO	Ant1	5230	36.124	5211.8581	5247.9820	---	---
11N40SISO	Ant1	5755	36.044	5736.9381	5772.9820	---	---
11N40SISO	Ant1	5795	36.204	5776.7782	5812.9820	---	---
11AC20SISO	Ant1	5180	17.782	5171.1289	5188.9111	---	---
11AC20SISO	Ant1	5200	17.982	5191.0090	5208.9910	---	---
11AC20SISO	Ant1	5240	17.902	5231.0490	5248.9510	---	---
11AC20SISO	Ant1	5745	17.942	5736.0490	5753.9910	---	---
11AC20SISO	Ant1	5785	18.182	5776.0090	5794.1908	---	---
11AC20SISO	Ant1	5825	18.062	5815.9291	5833.9910	---	---
11AC40SISO	Ant1	5190	36.204	5171.9381	5208.1419	---	---
11AC40SISO	Ant1	5230	36.444	5211.6983	5248.1419	---	---
11AC40SISO	Ant1	5755	36.364	5736.8581	5773.2218	---	---
11AC40SISO	Ant1	5795	36.124	5777.0180	5813.1419	---	---
11AC80SISO	Ant1	5210	75.445	5172.2777	5247.7223	---	---
11AC80SISO	Ant1	5775	75.604	5737.1179	5812.7223	---	---

Test Graphs

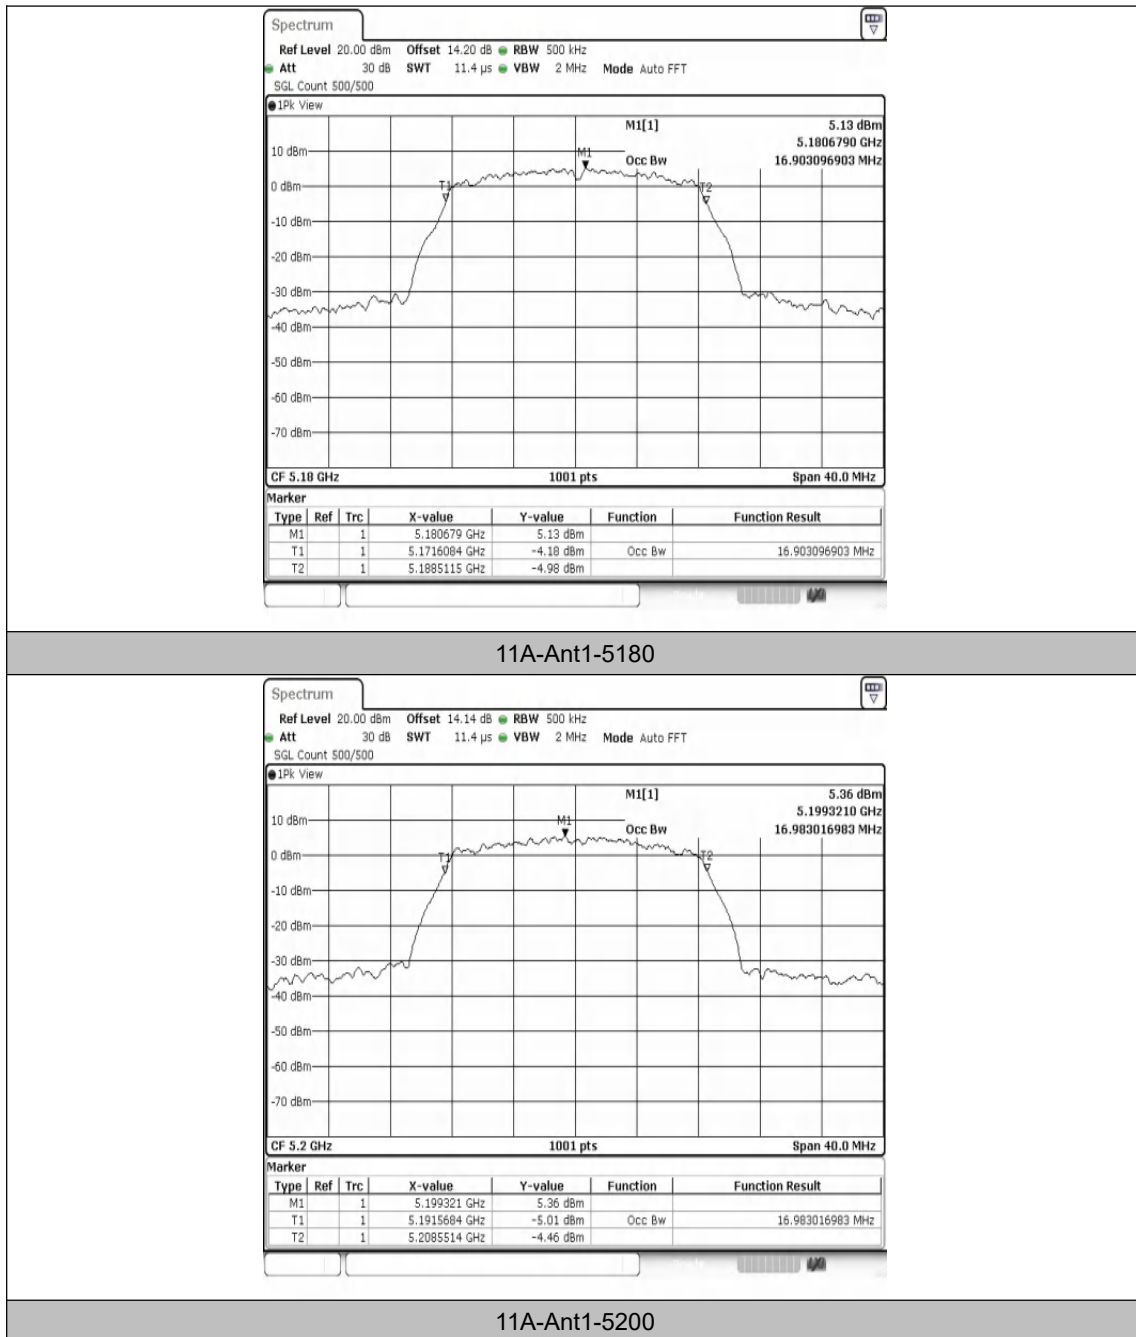


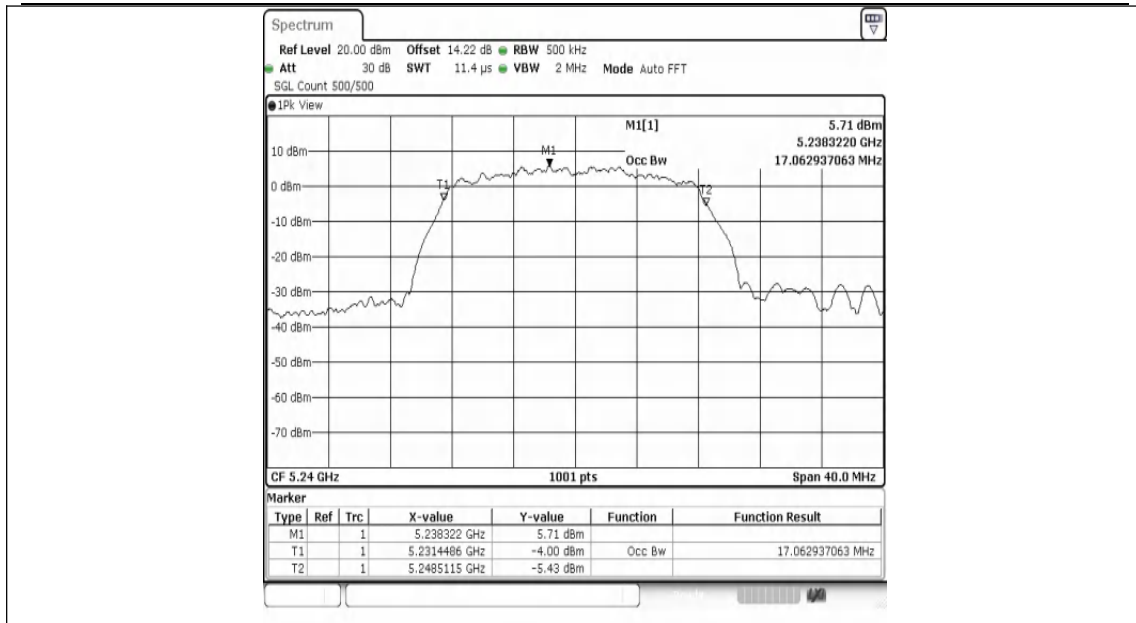



11A-Ant1-5240

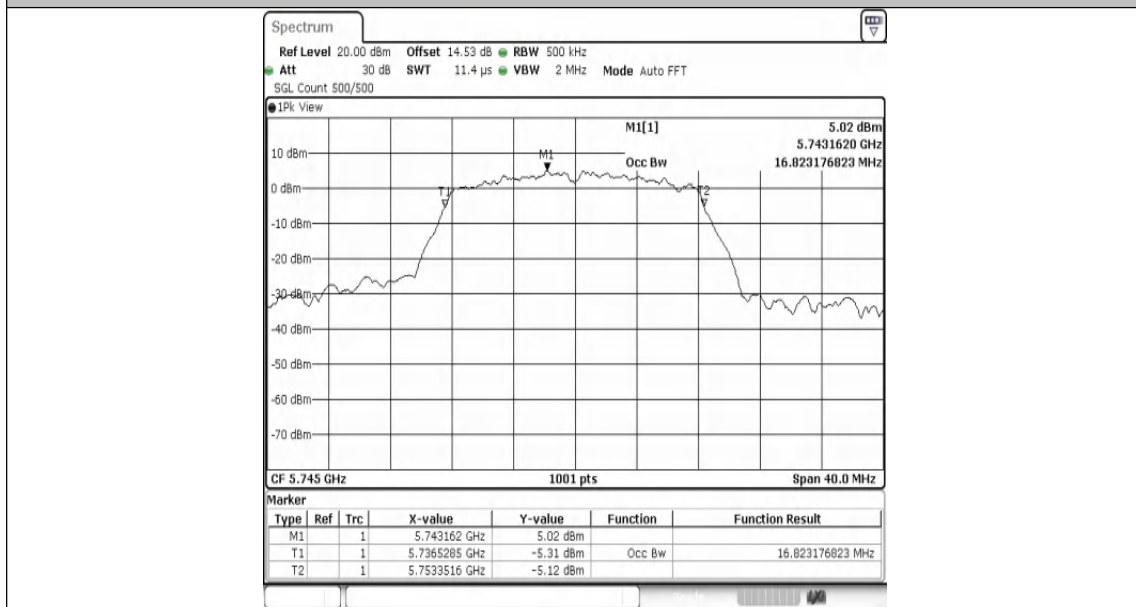



11A-Ant1-5745

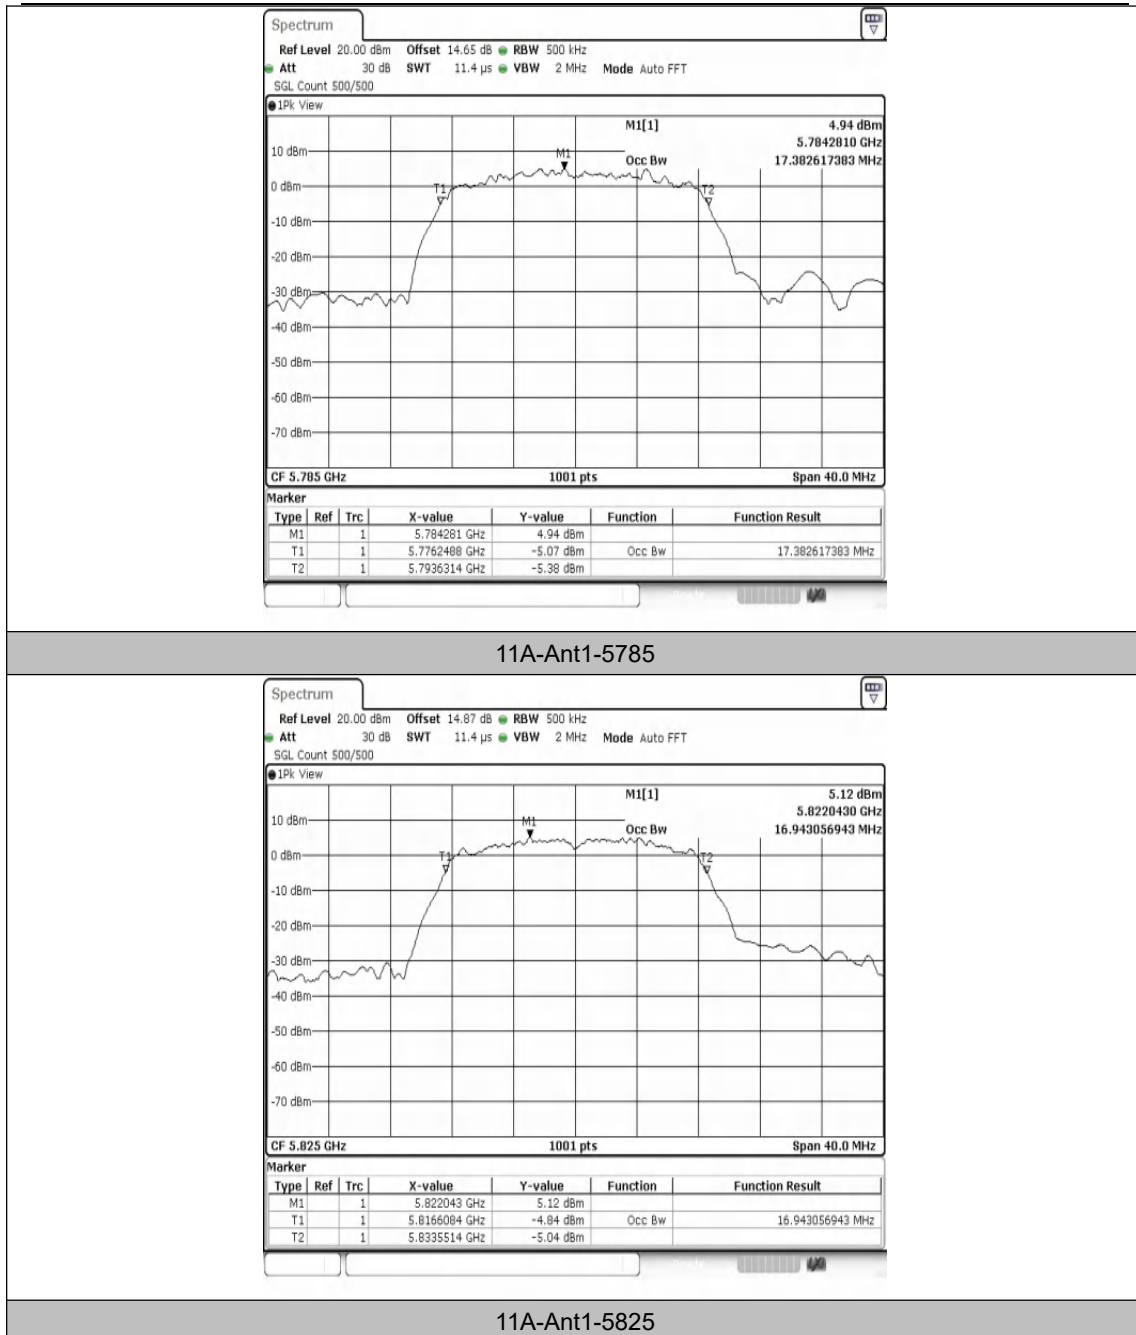


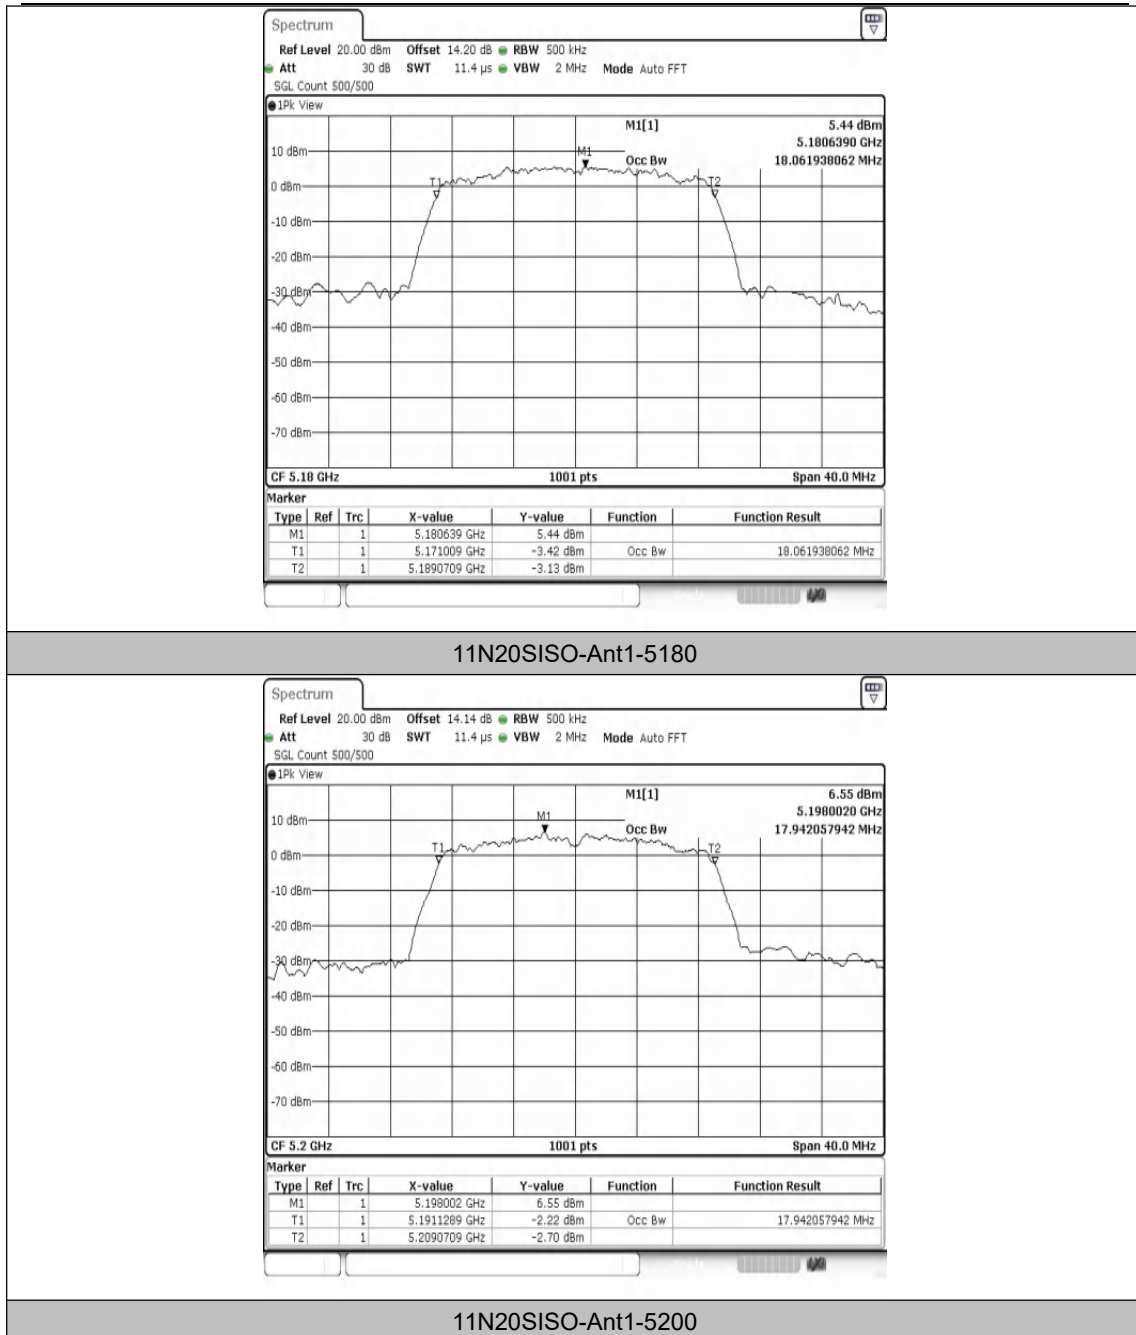


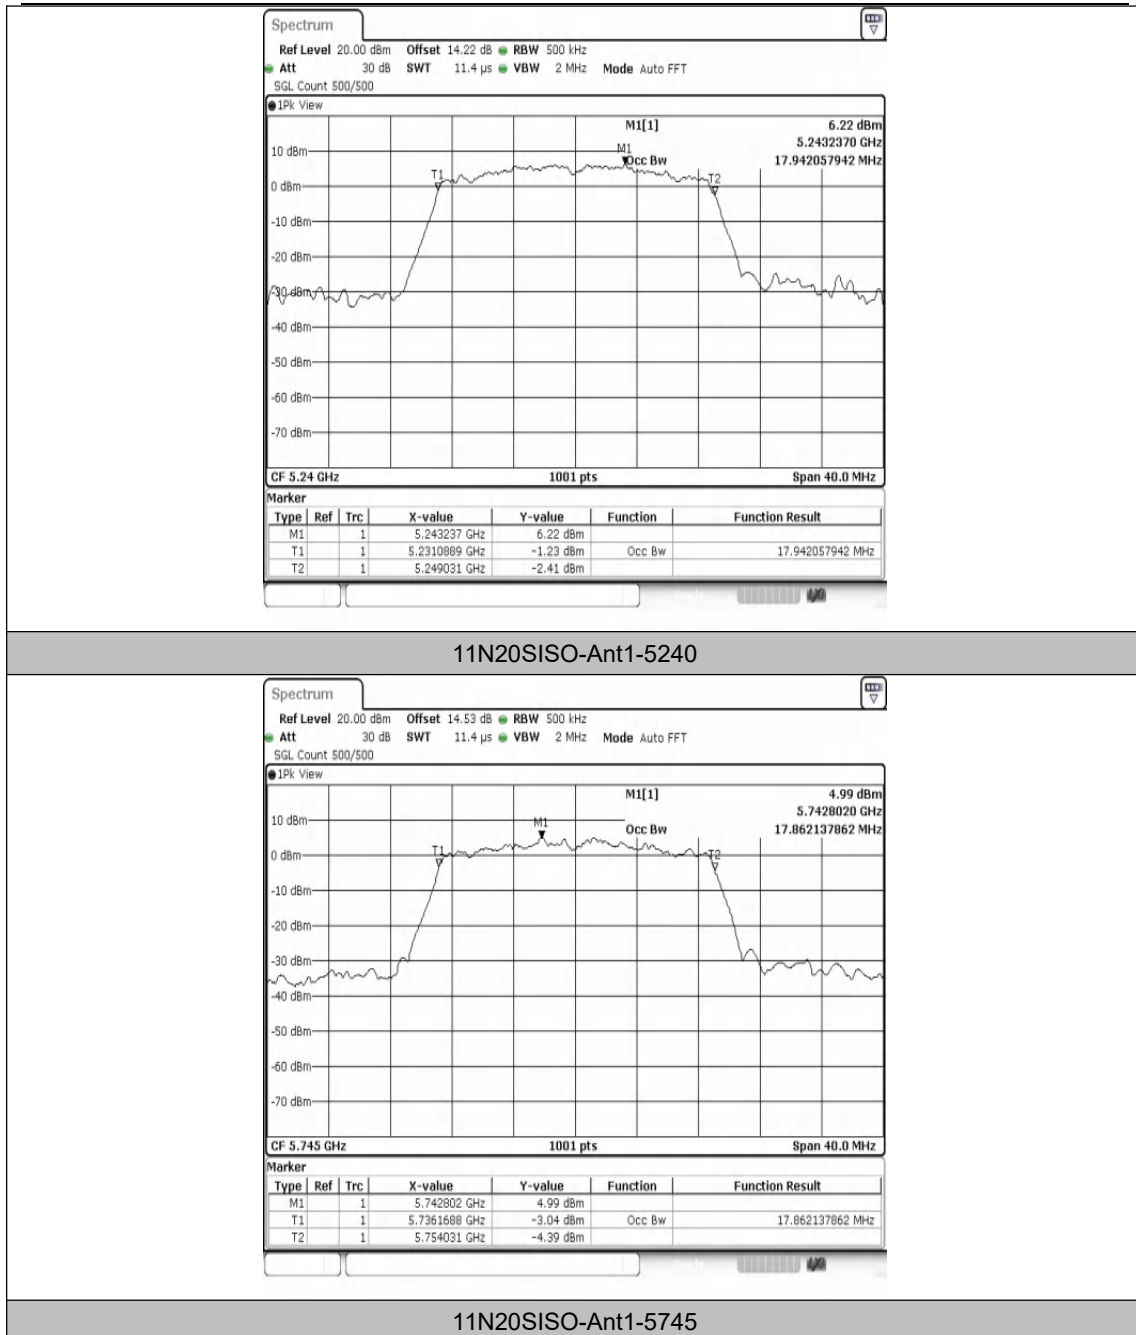


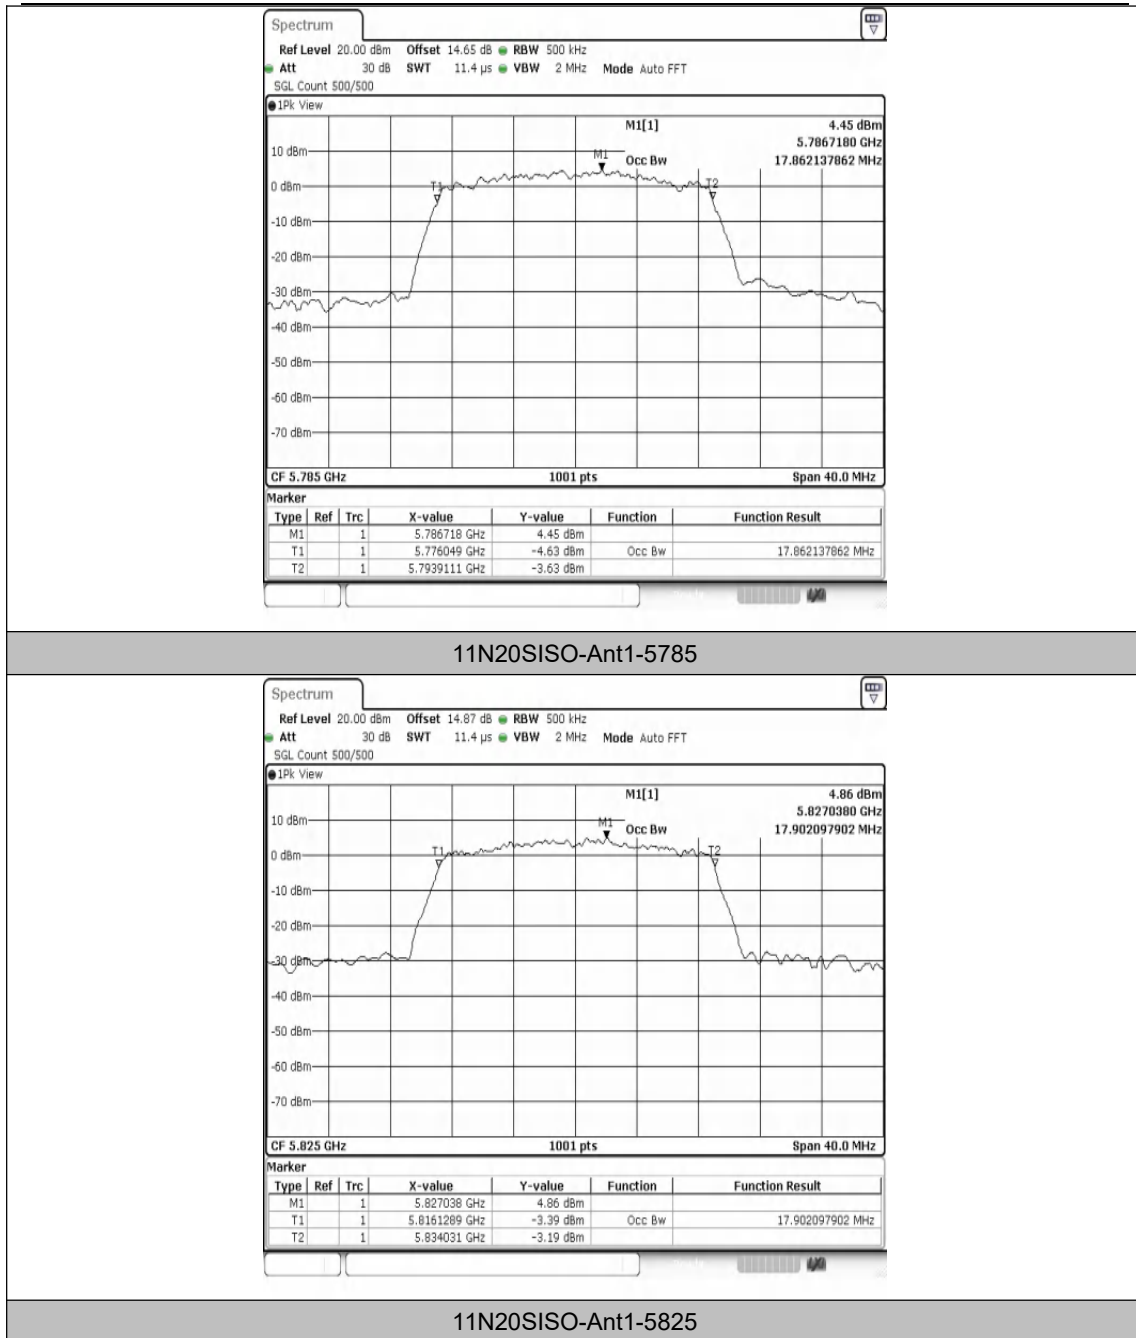


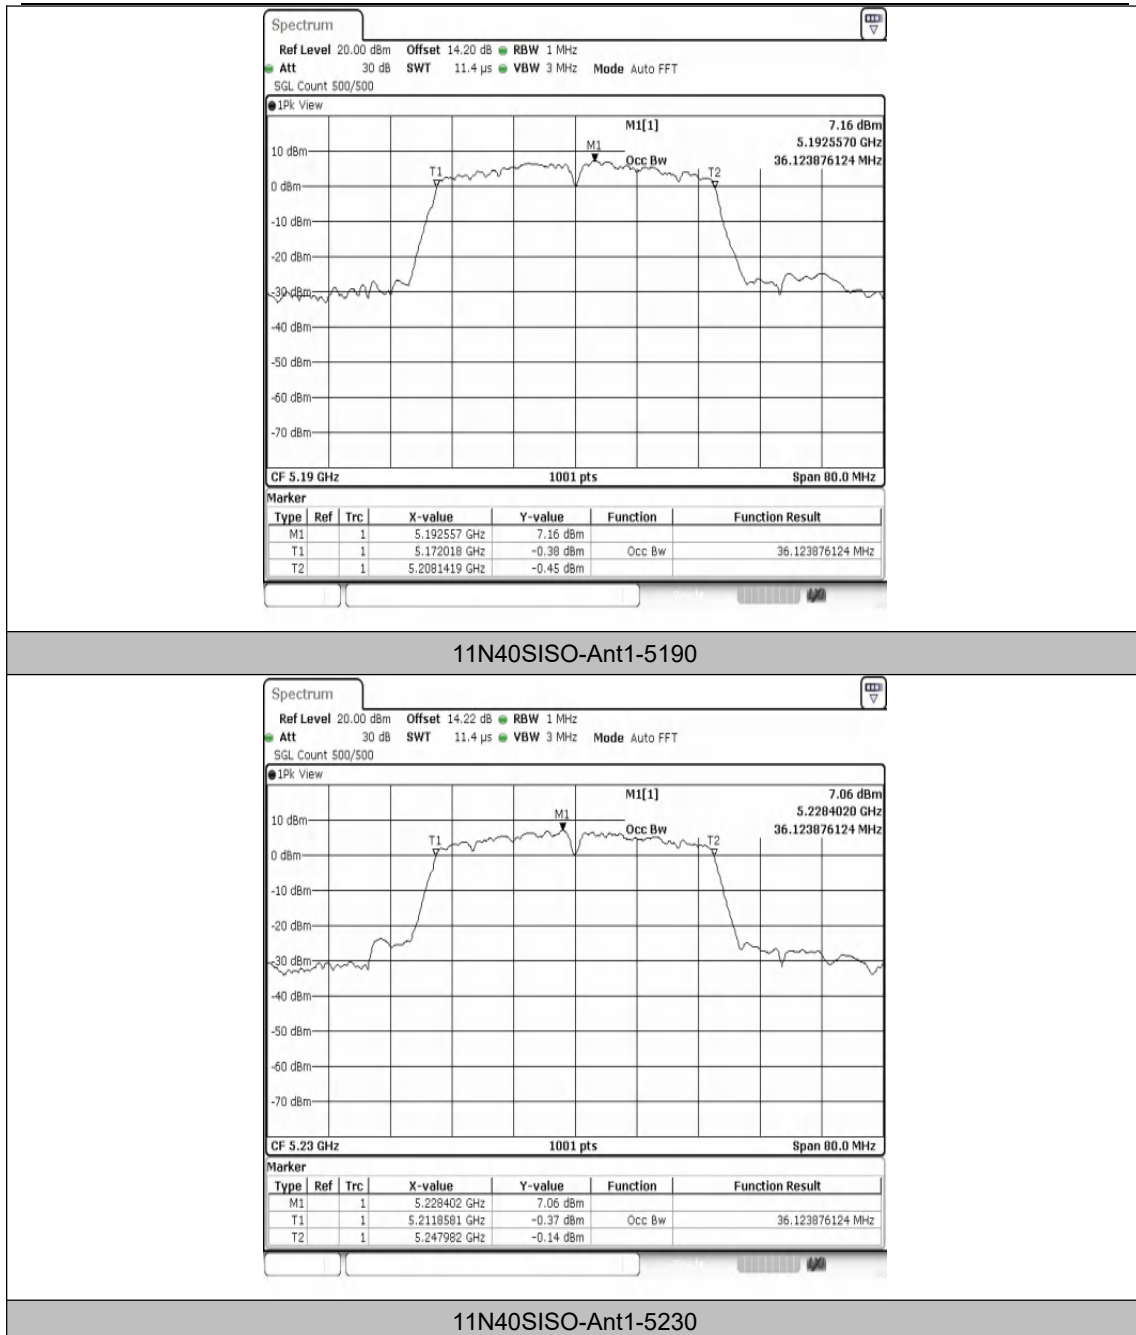


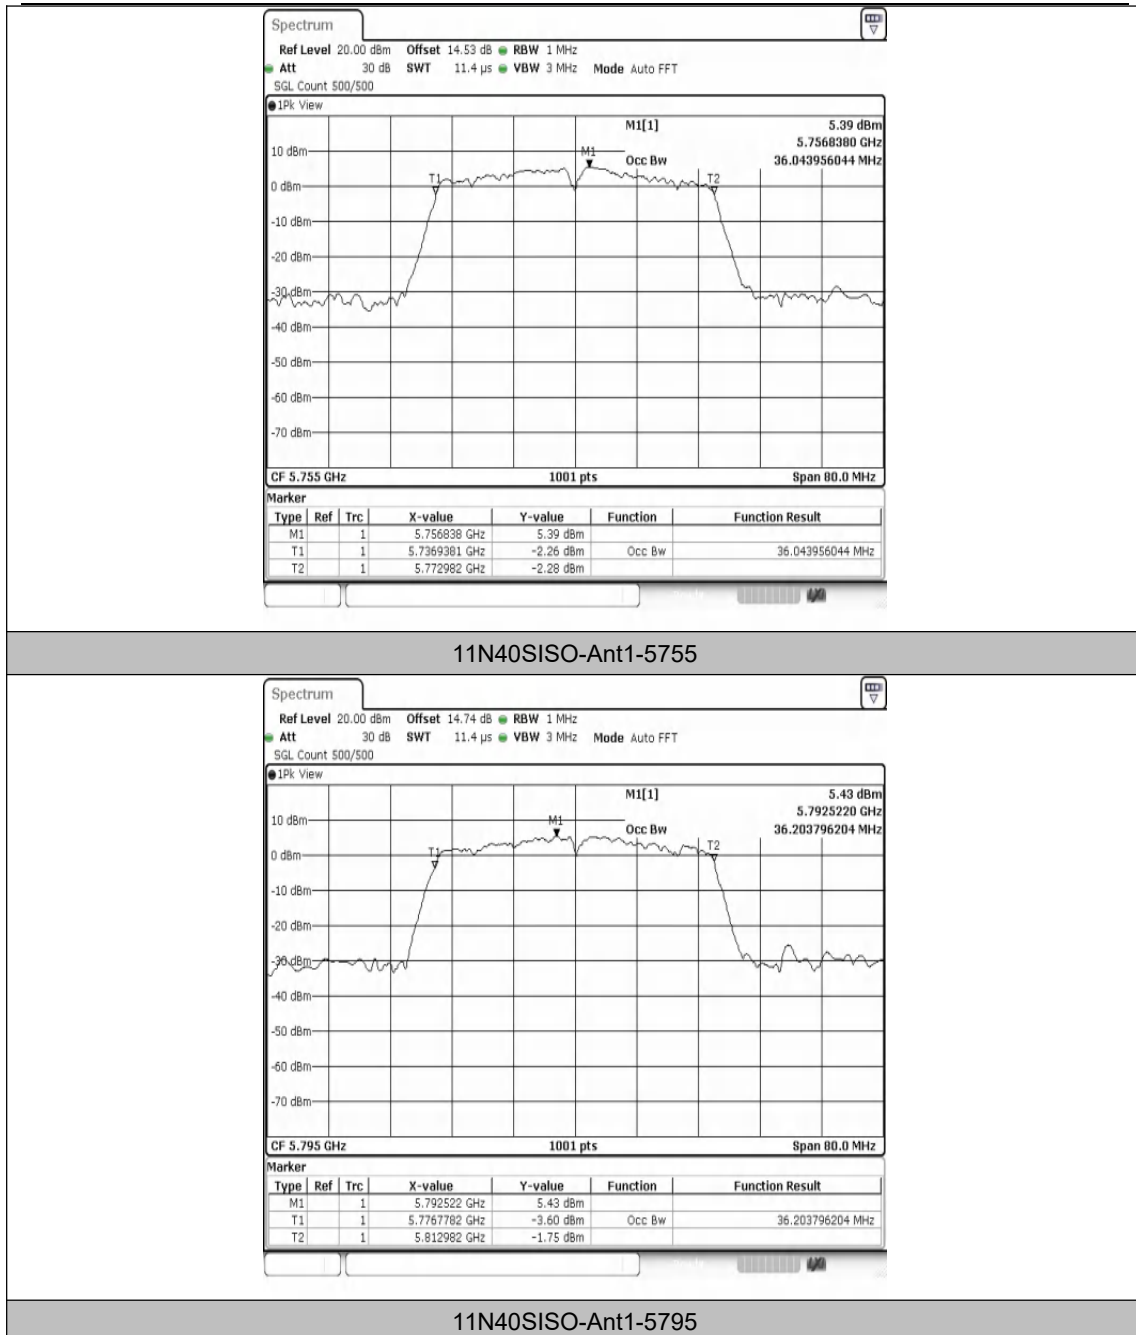

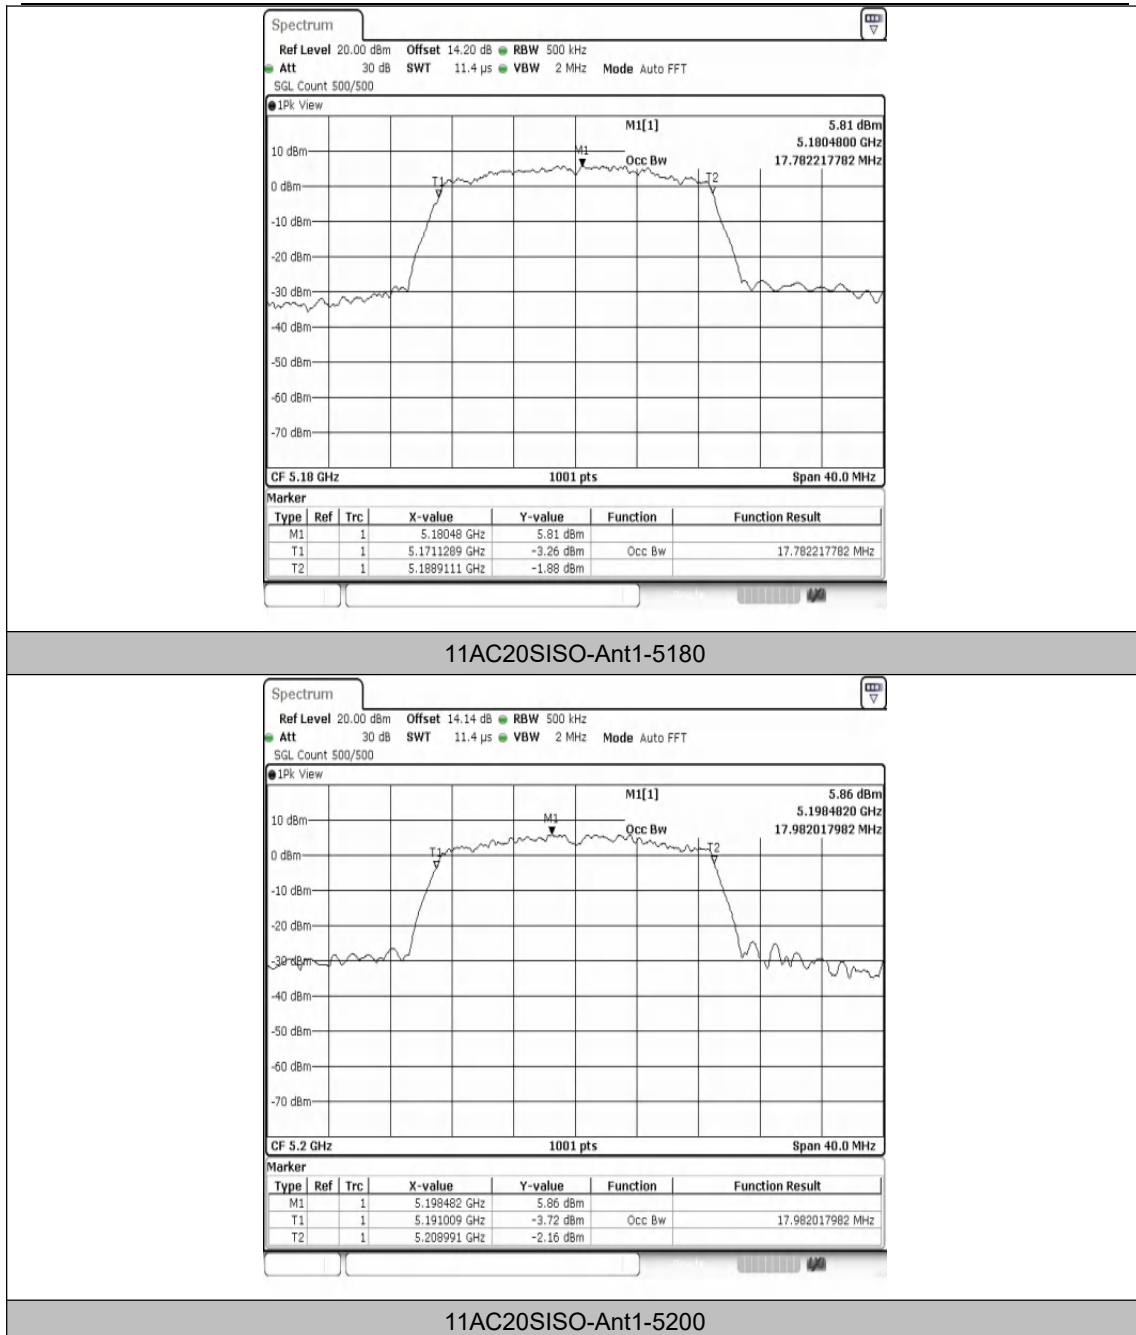


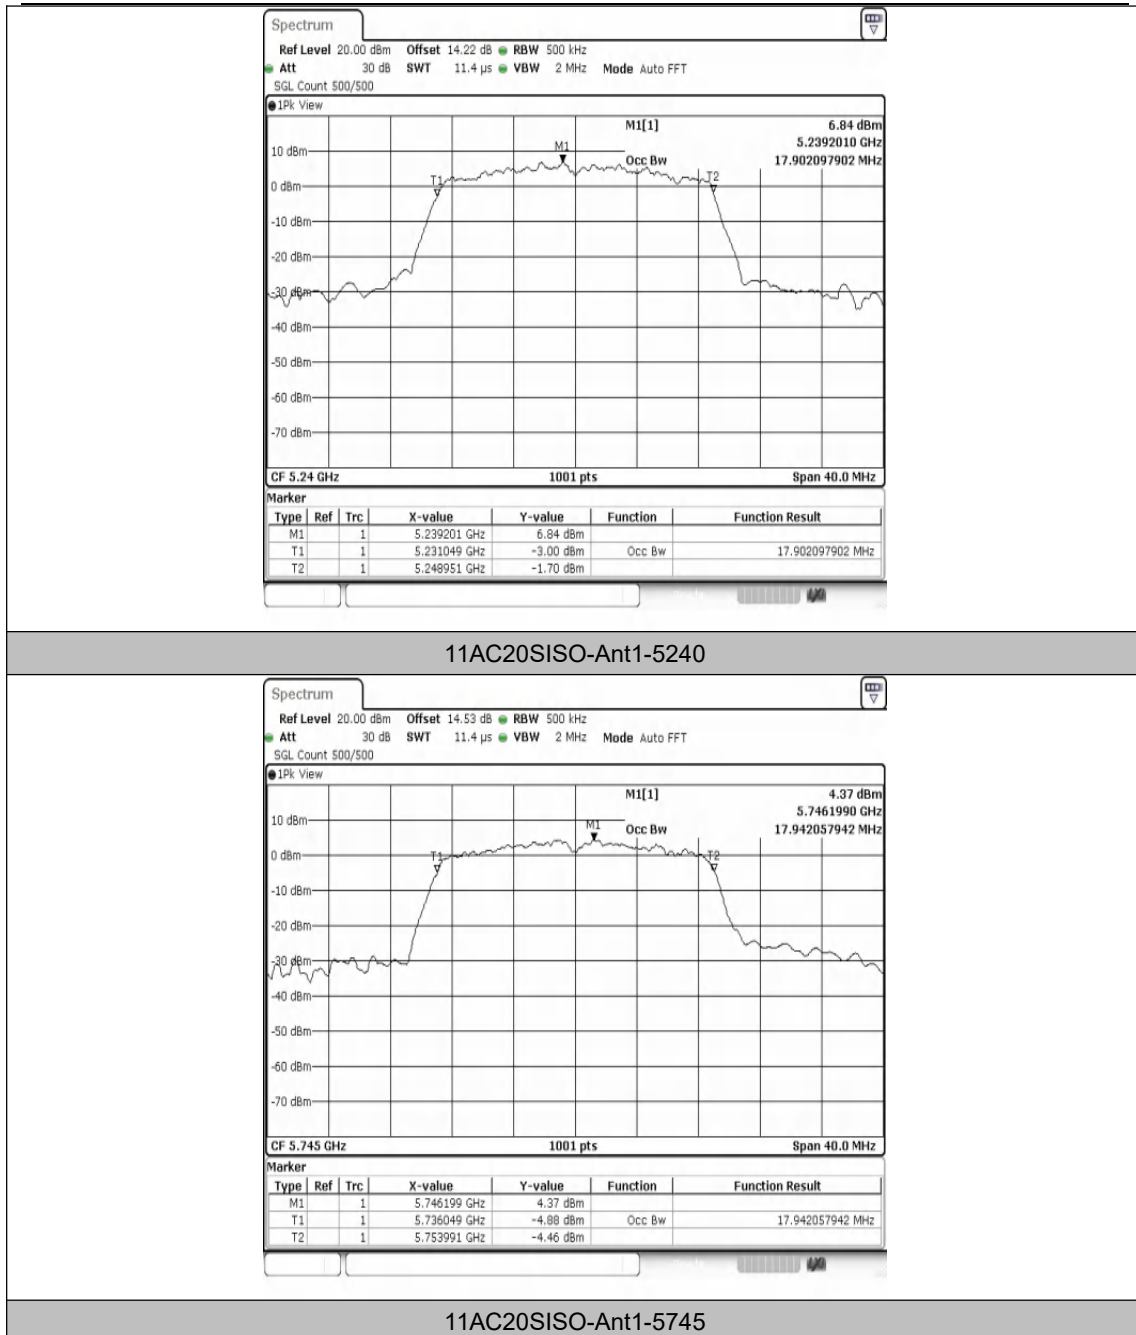

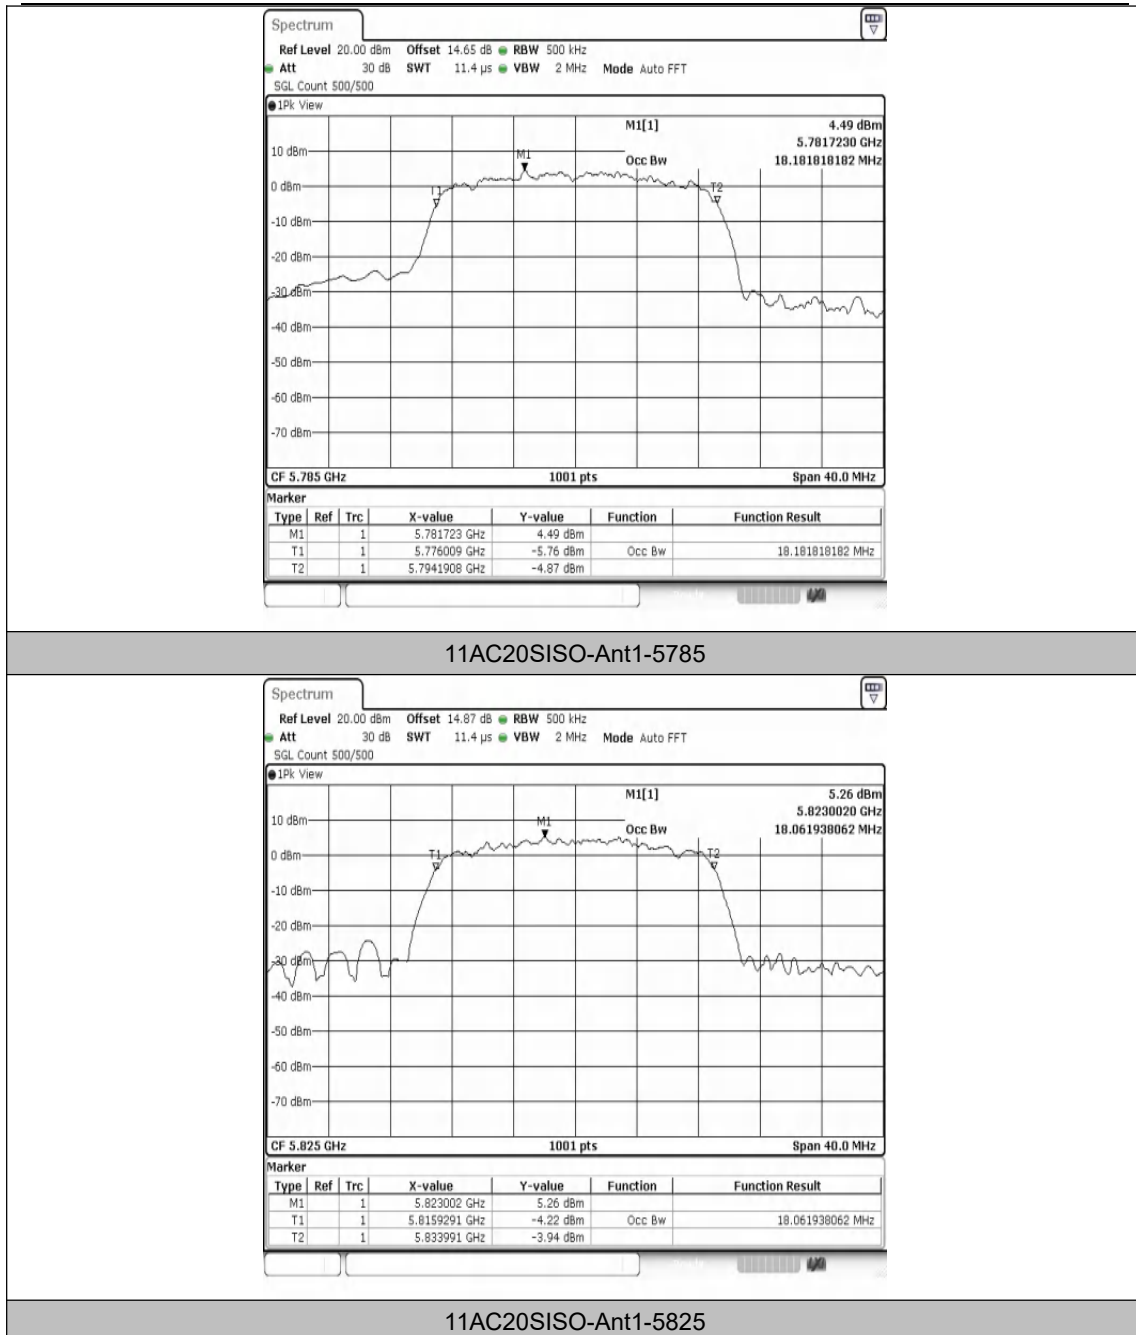


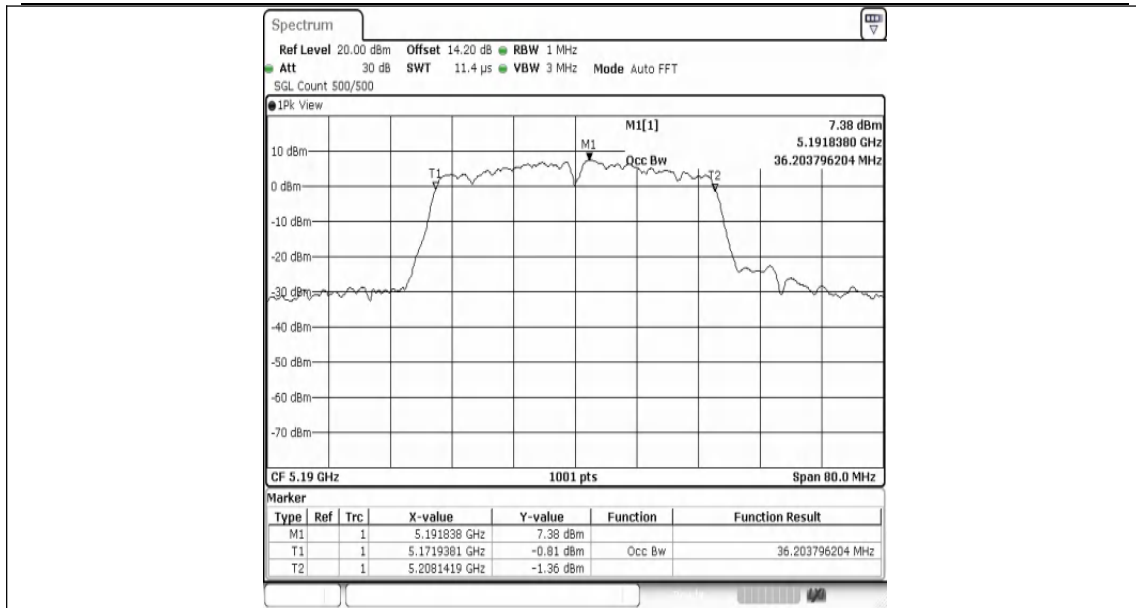

11AC40SISO-Ant1-5190

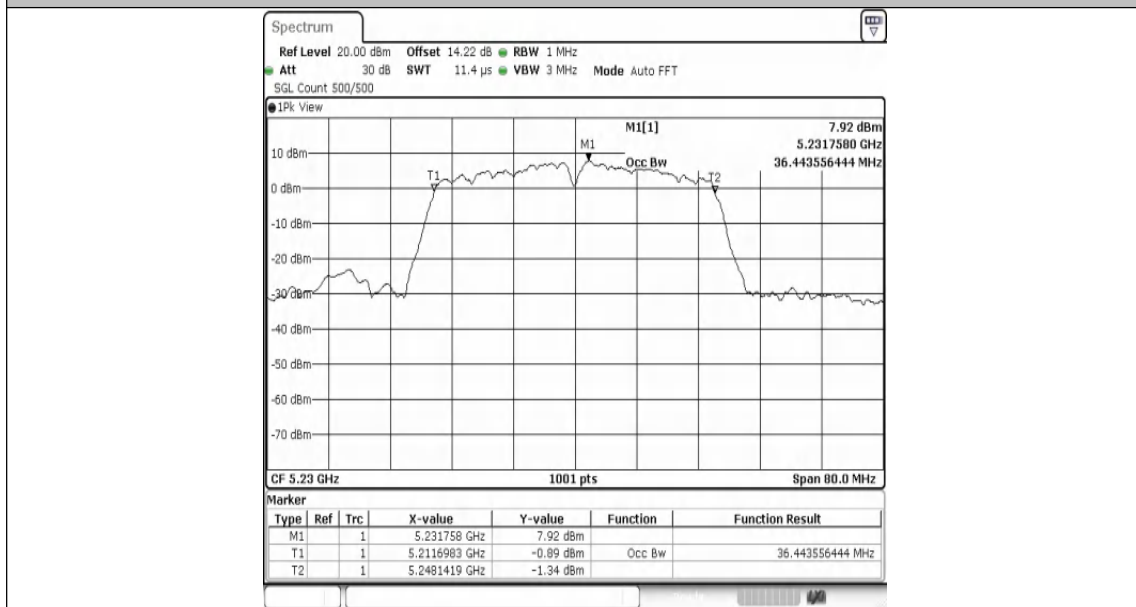


11AC40SISO-Ant1-5230

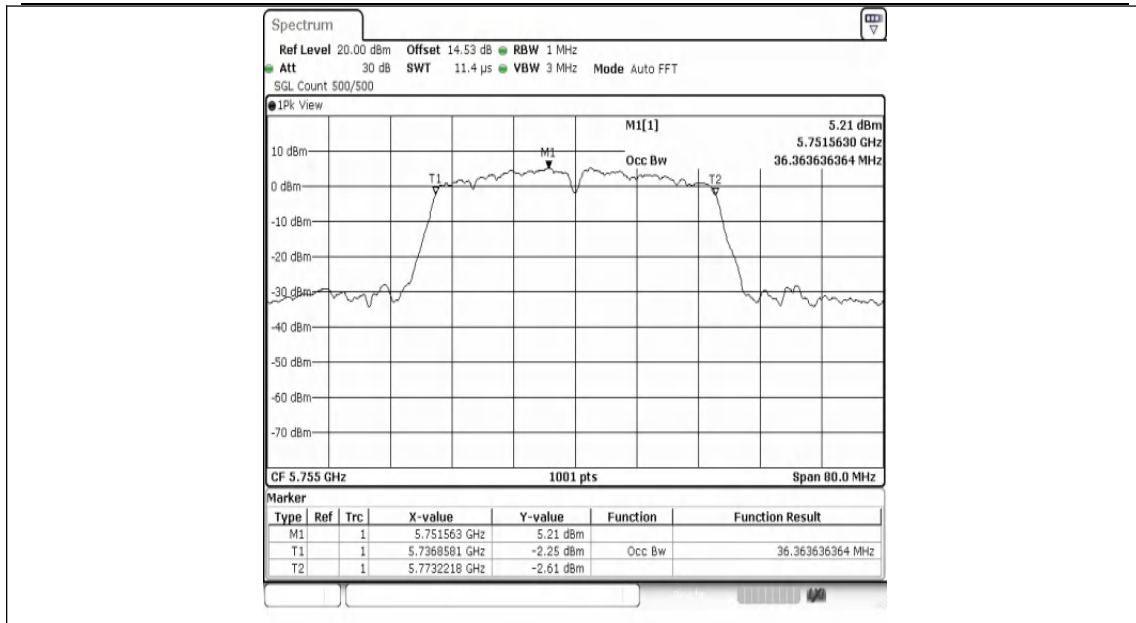

11AC40SISO-Ant1-5755



11AC40SISO-Ant1-5795

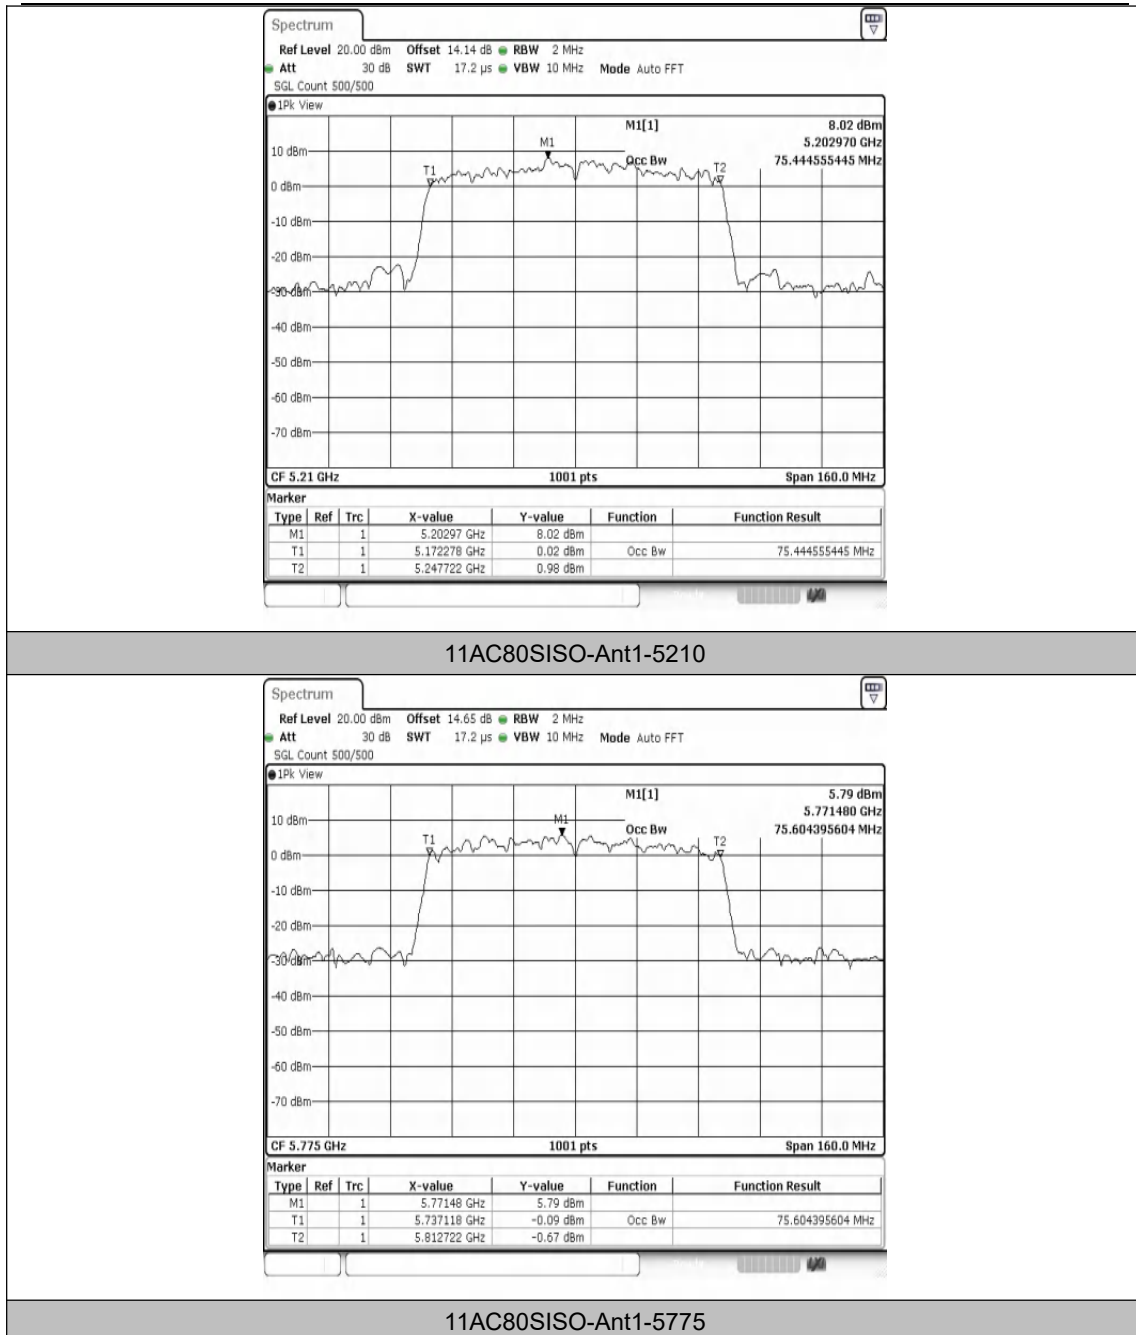



Appendix A3: Minimum 6dB Bandwidth


Test Result B4


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	16.32	5736.84	5753.16	0.5	PASS
11A	Ant1	5785	16.32	5776.84	5793.16	0.5	PASS
11A	Ant1	5825	16.32	5816.84	5833.16	0.5	PASS
11N20SISO	Ant1	5745	17.56	5736.20	5753.76	0.5	PASS
11N20SISO	Ant1	5785	17.60	5776.20	5793.80	0.5	PASS
11N20SISO	Ant1	5825	17.60	5816.20	5833.80	0.5	PASS
11N40SISO	Ant1	5755	35.92	5736.84	5772.76	0.5	PASS
11N40SISO	Ant1	5795	36.32	5776.84	5813.16	0.5	PASS
11AC20SISO	Ant1	5745	17.60	5736.20	5753.80	0.5	PASS
11AC20SISO	Ant1	5785	17.60	5776.20	5793.80	0.5	PASS
11AC20SISO	Ant1	5825	17.60	5816.20	5833.80	0.5	PASS
11AC40SISO	Ant1	5755	36.32	5736.84	5773.16	0.5	PASS
11AC40SISO	Ant1	5795	36.32	5776.84	5813.16	0.5	PASS
11AC80SISO	Ant1	5775	76.48	5736.76	5813.24	0.5	PASS

Test Graphs B4

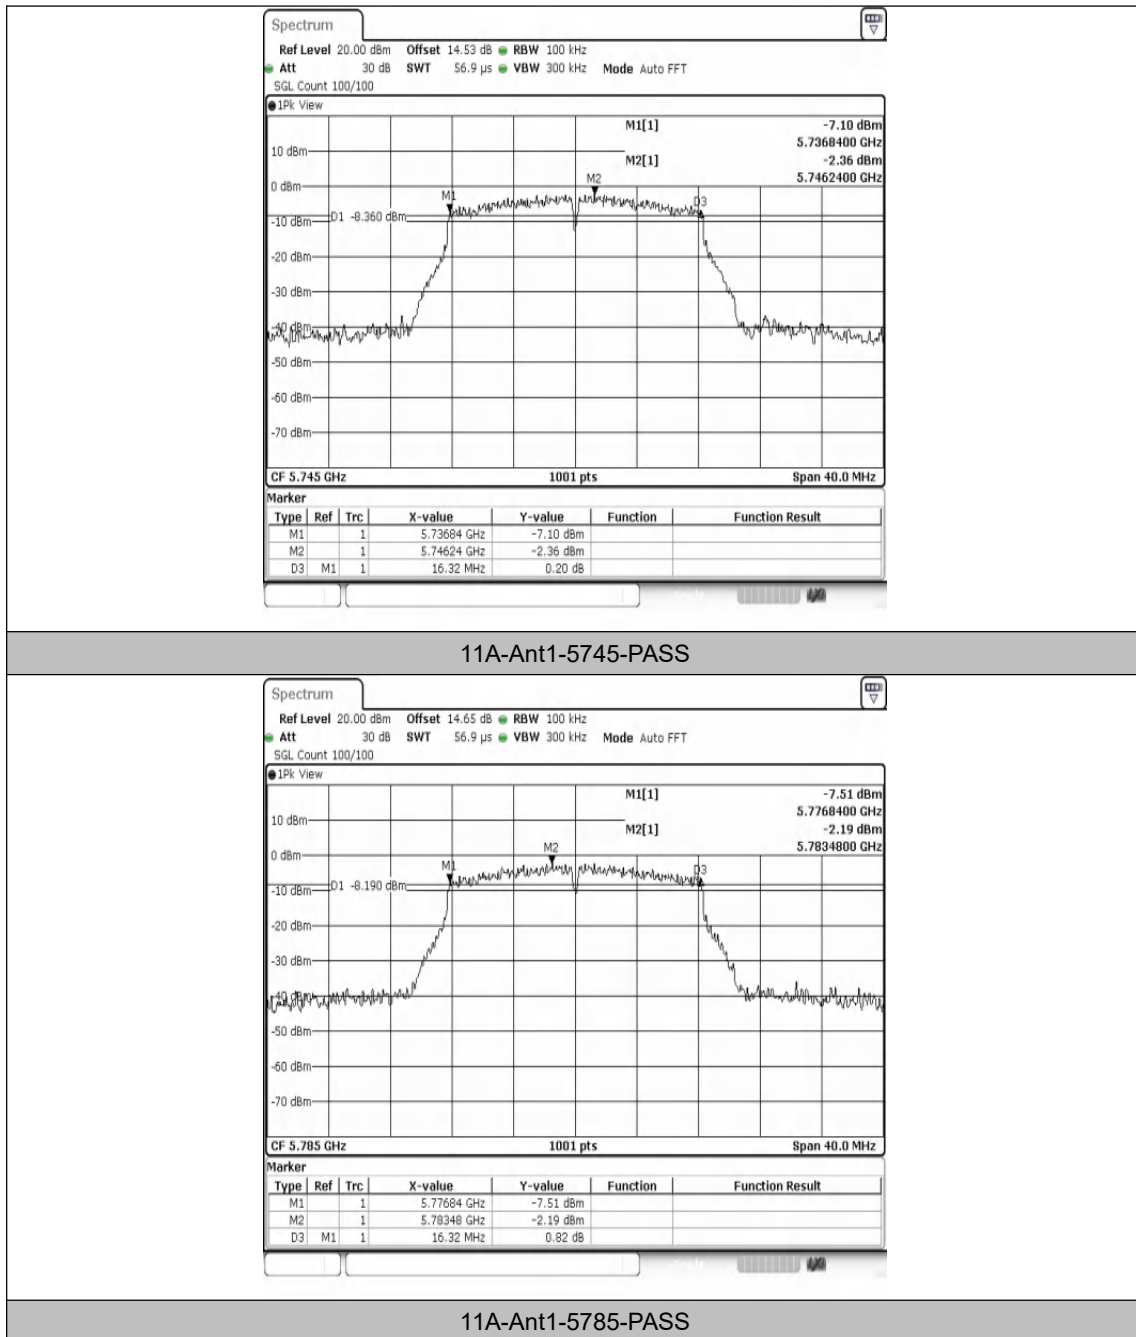


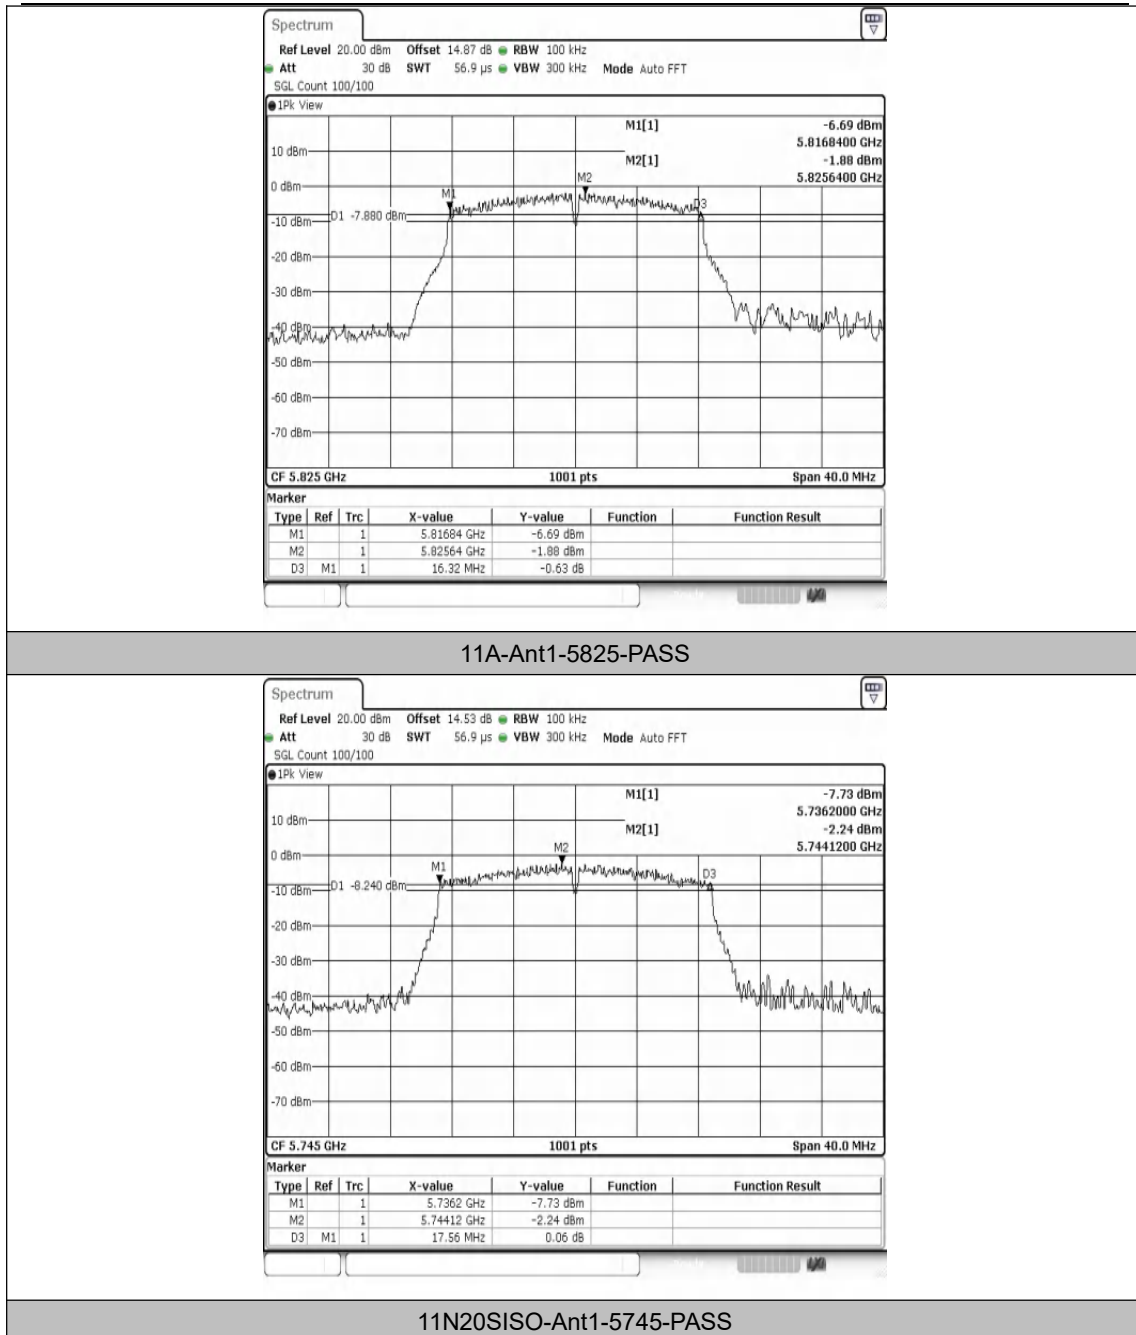

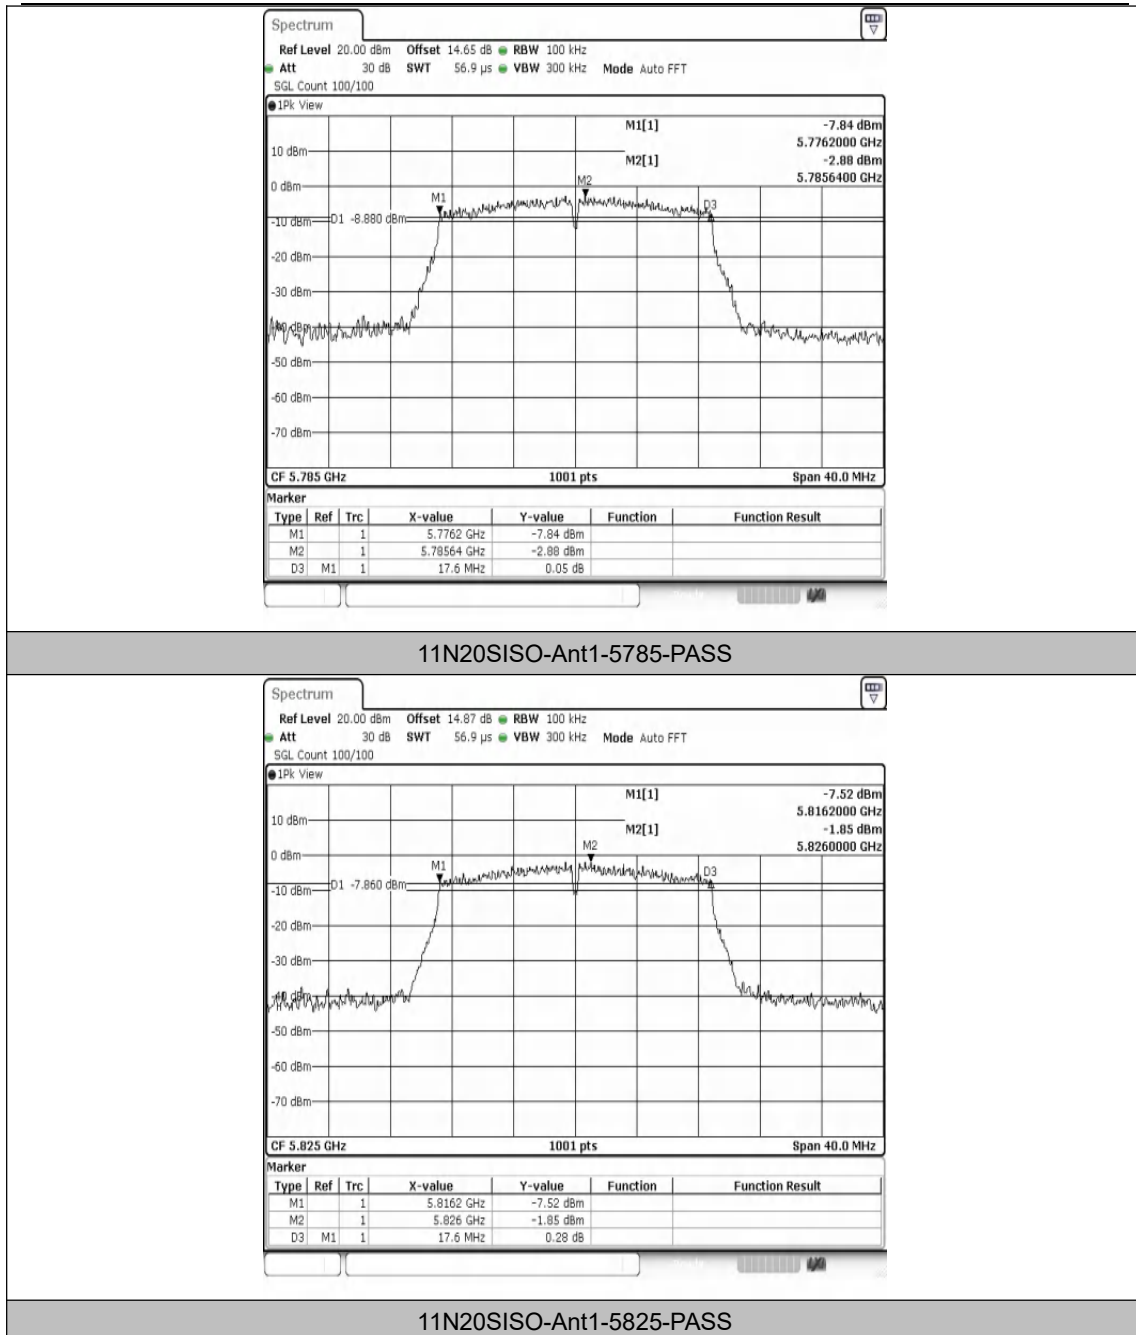


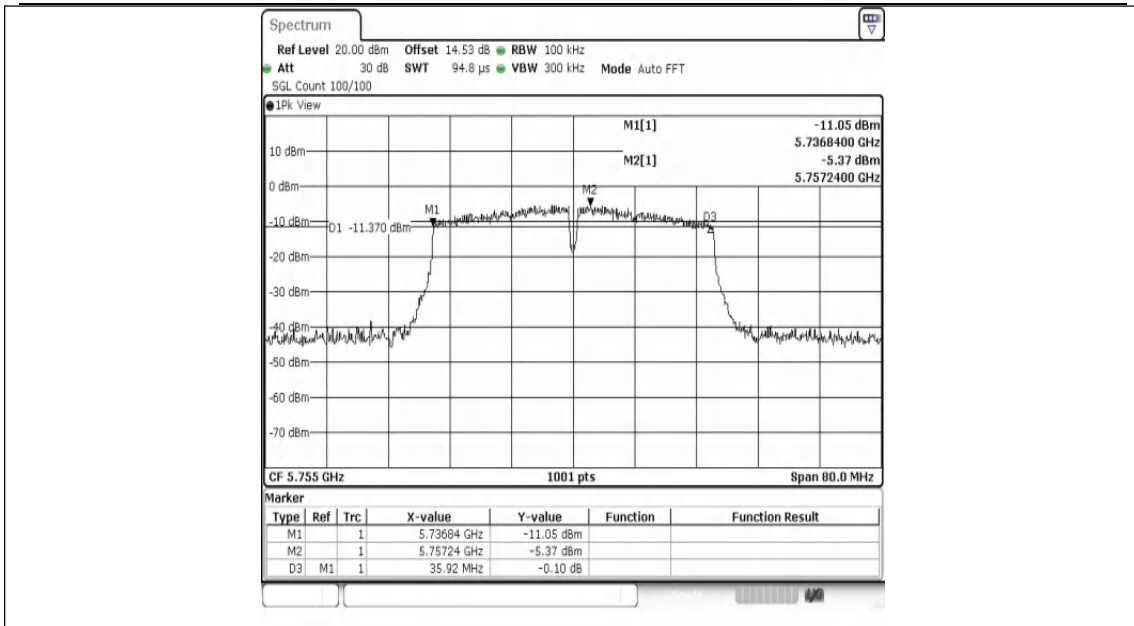



11N40SISO-Ant1-5755-PASS

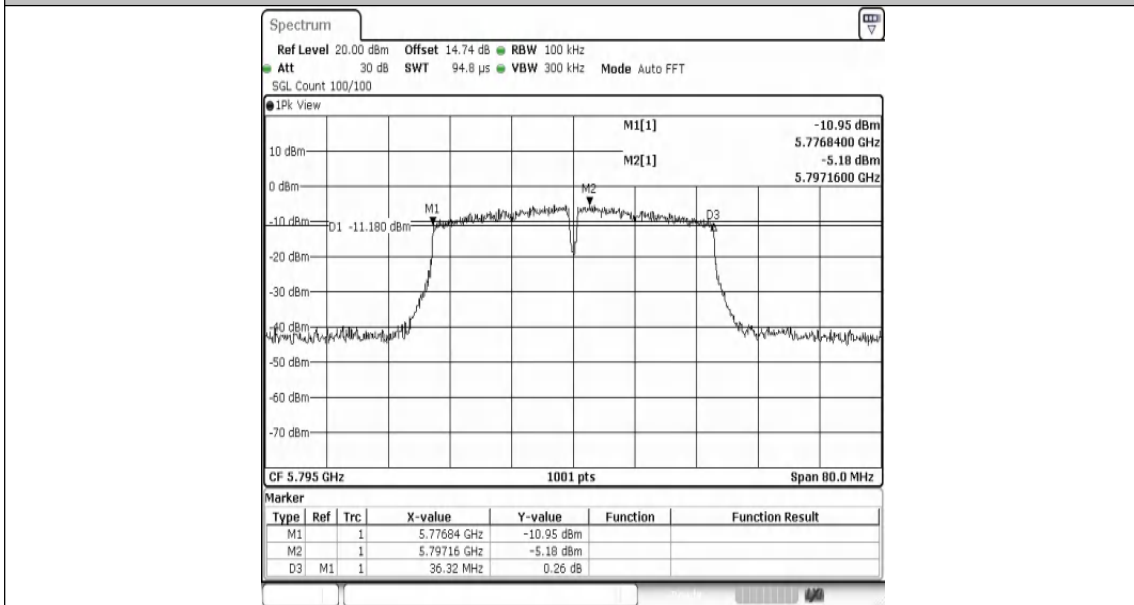


11N40SISO-Ant1-5795-PASS

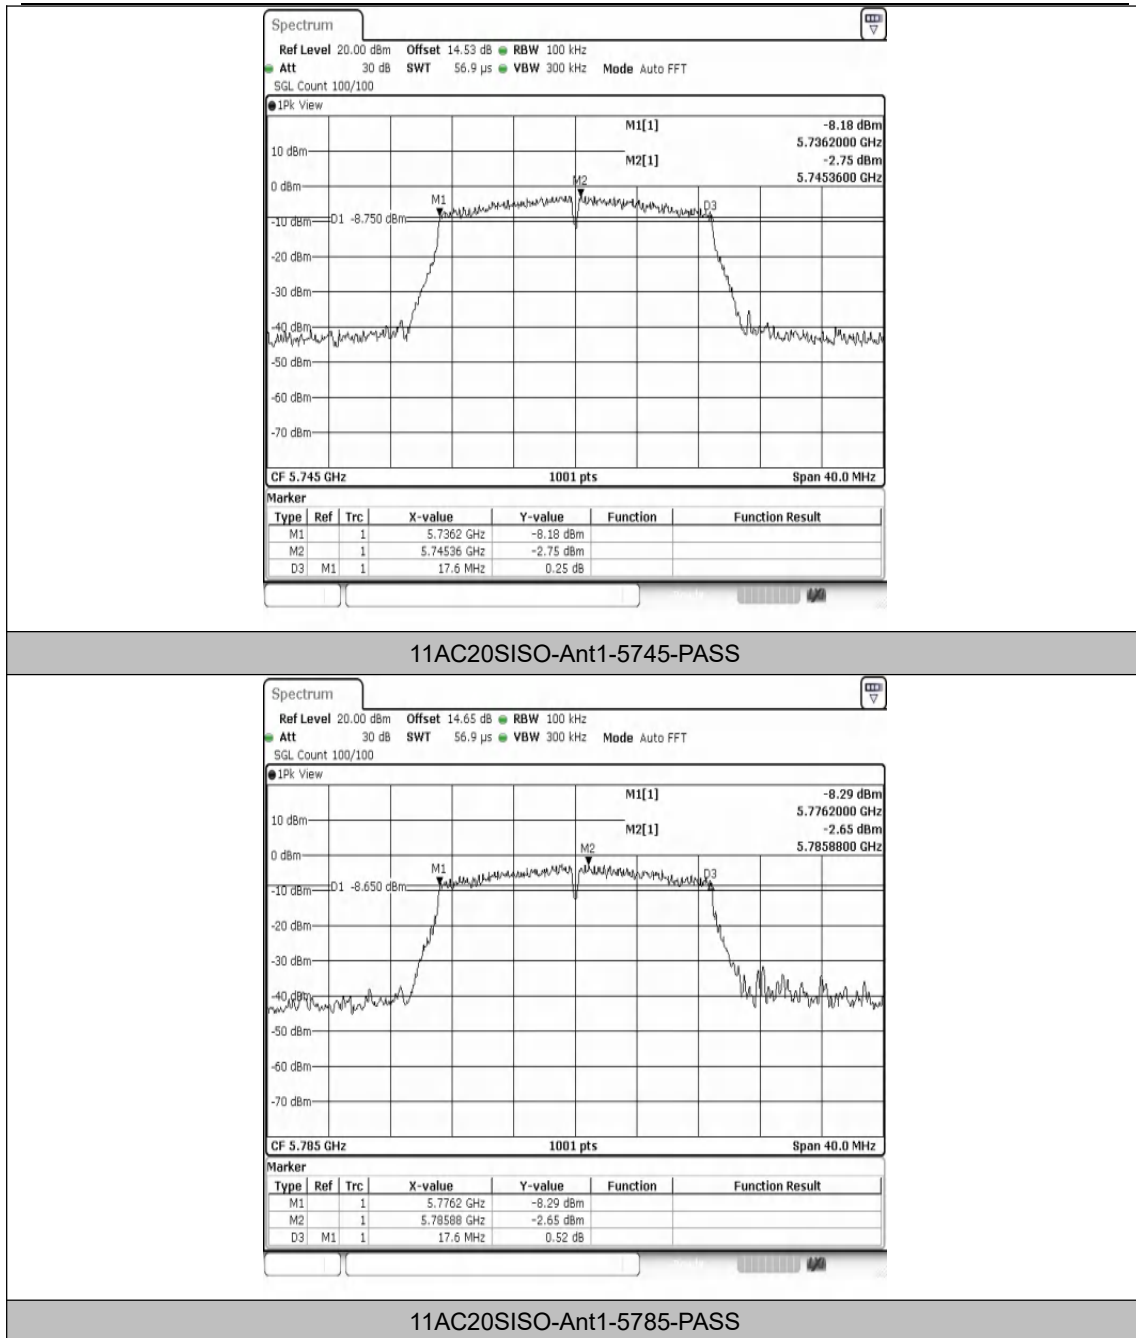

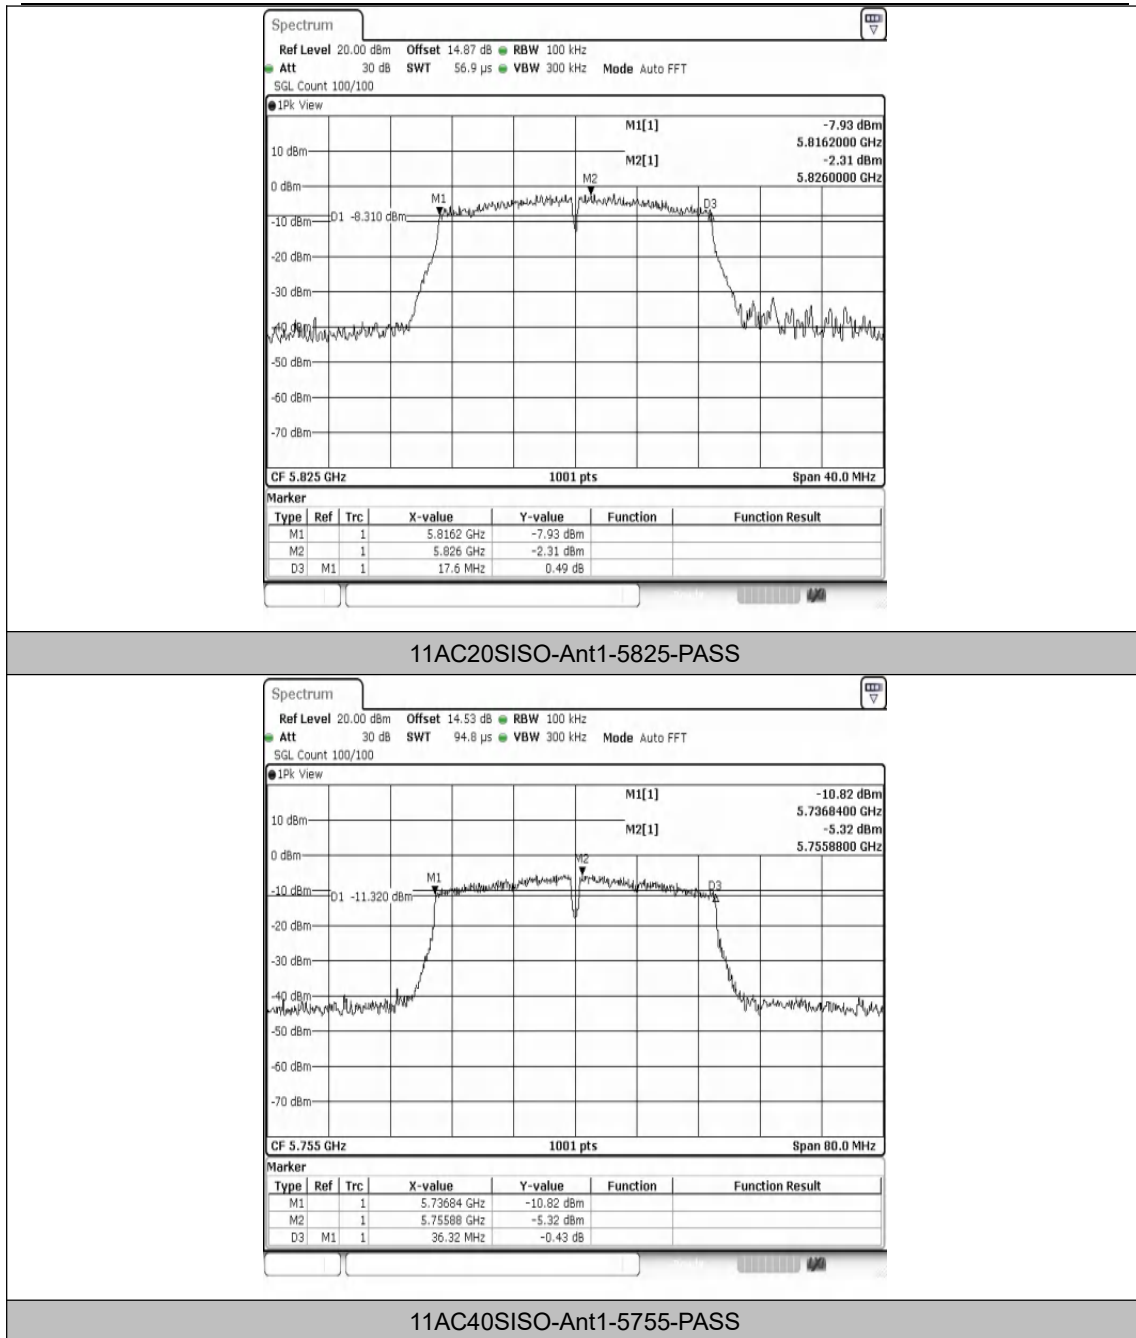

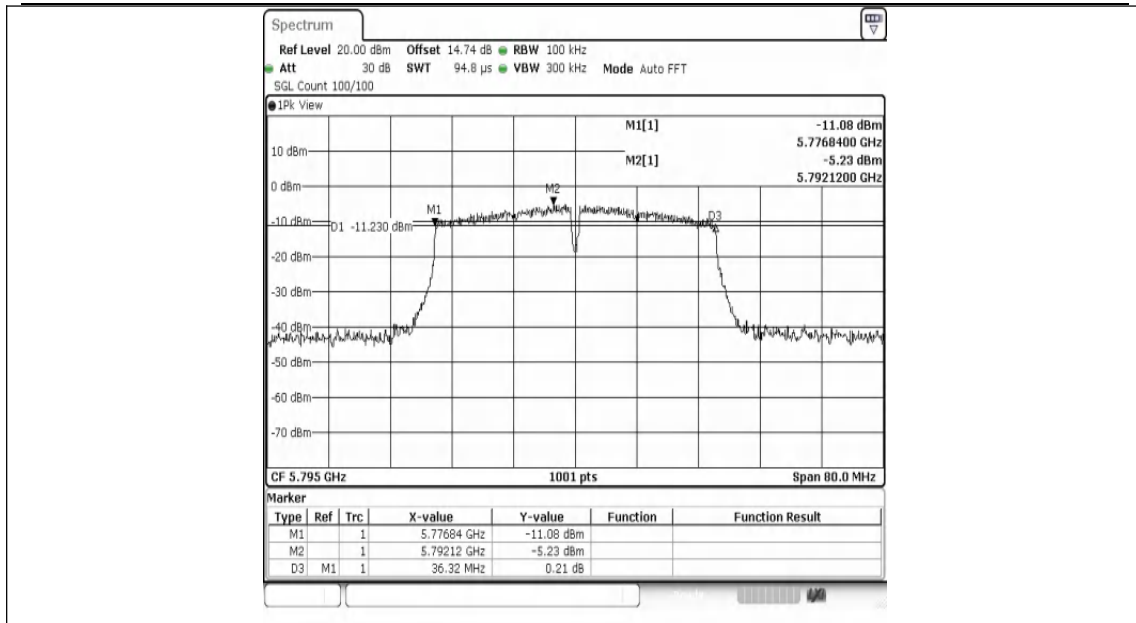

11AC40SISO-Ant1-5795-PASS

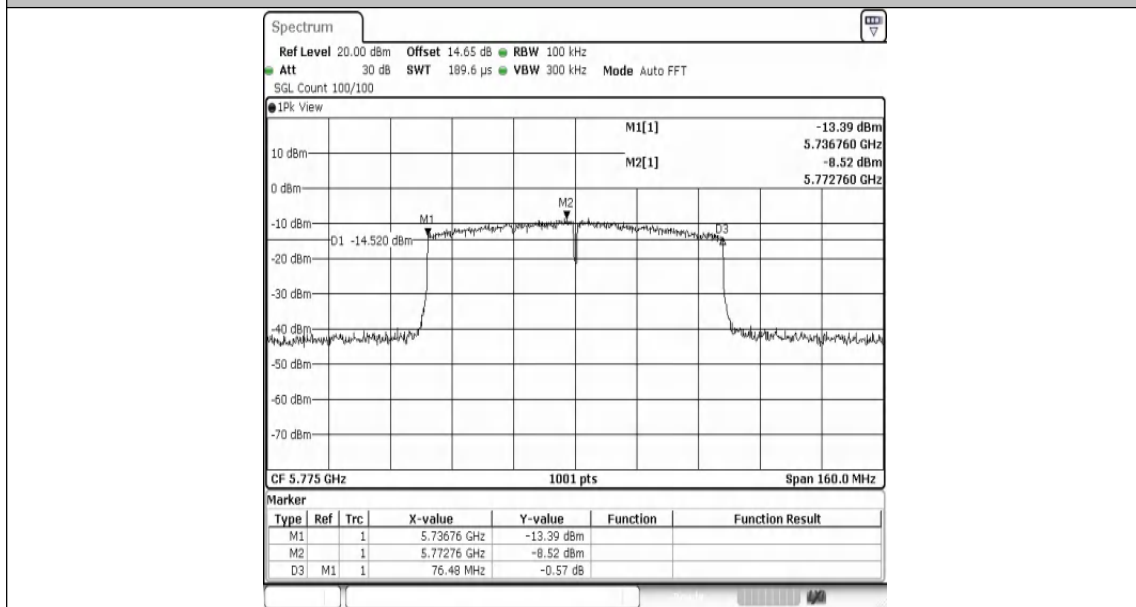


11AC80SISO-Ant1-5775-PASS

Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11A	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11N20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11N40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5180	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5200	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5240	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5745	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5785	100.00	100.00	100.00	0.00	0.01
11AC20SISO	Ant1	5825	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5190	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5230	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5755	100.00	100.00	100.00	0.00	0.01
11AC40SISO	Ant1	5795	100.00	100.00	100.00	0.00	0.01
11AC80SISO	Ant1	5210	100.00	100.00	100.00	0.00	0.01
11AC80SISO	Ant1	5775	100.00	100.00	100.00	0.00	0.01


Test Graphs

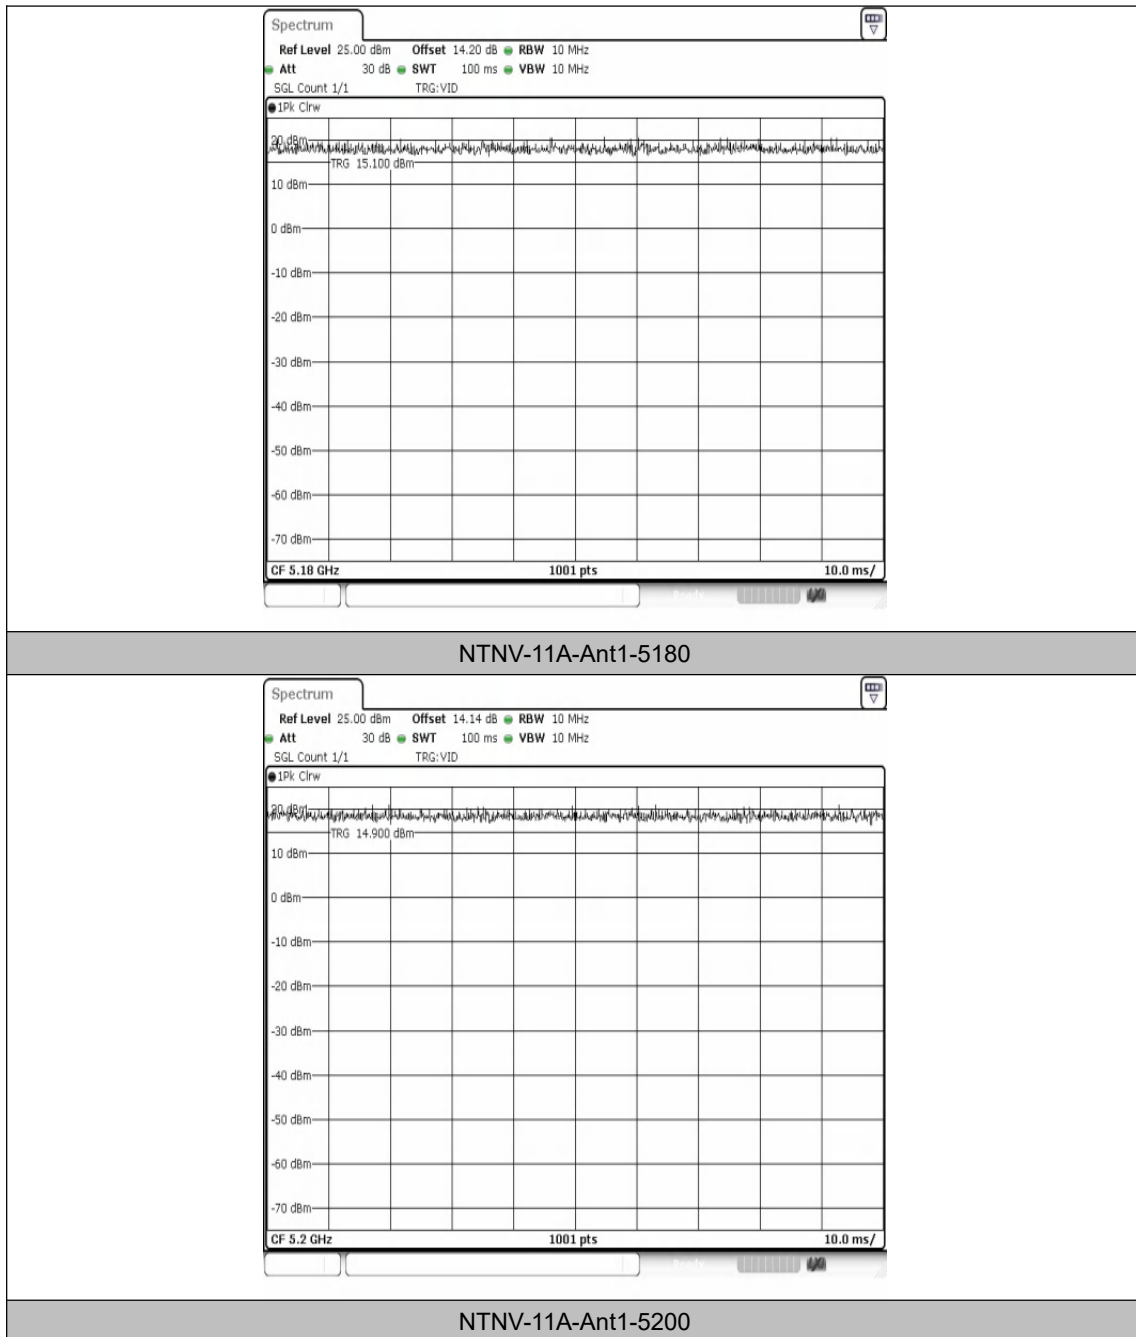

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

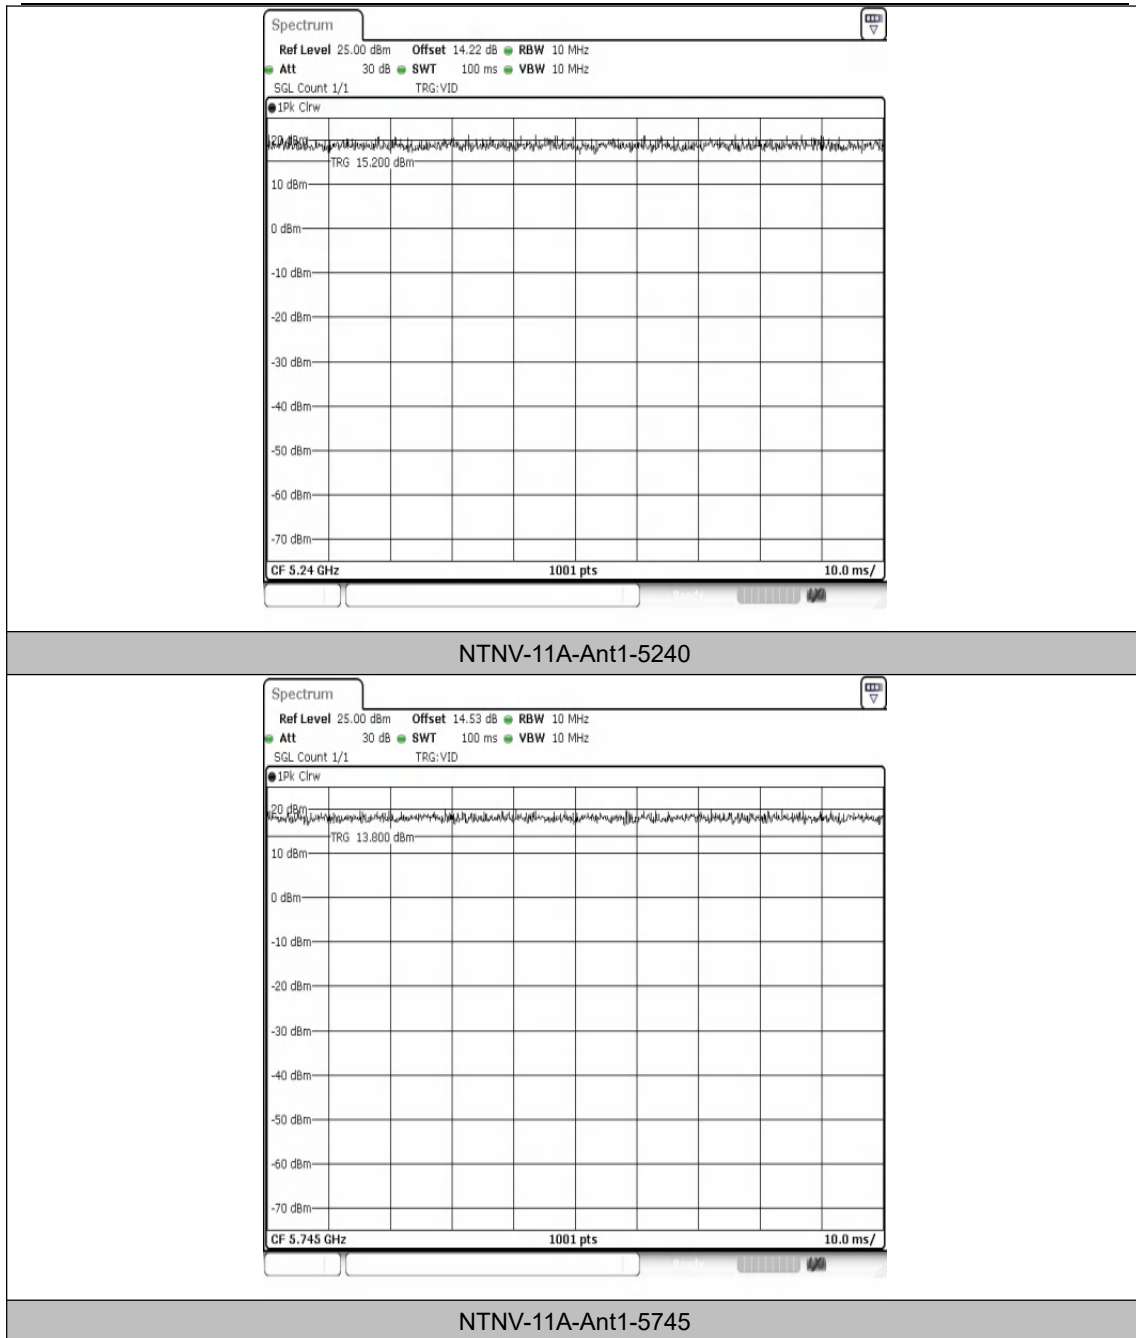

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

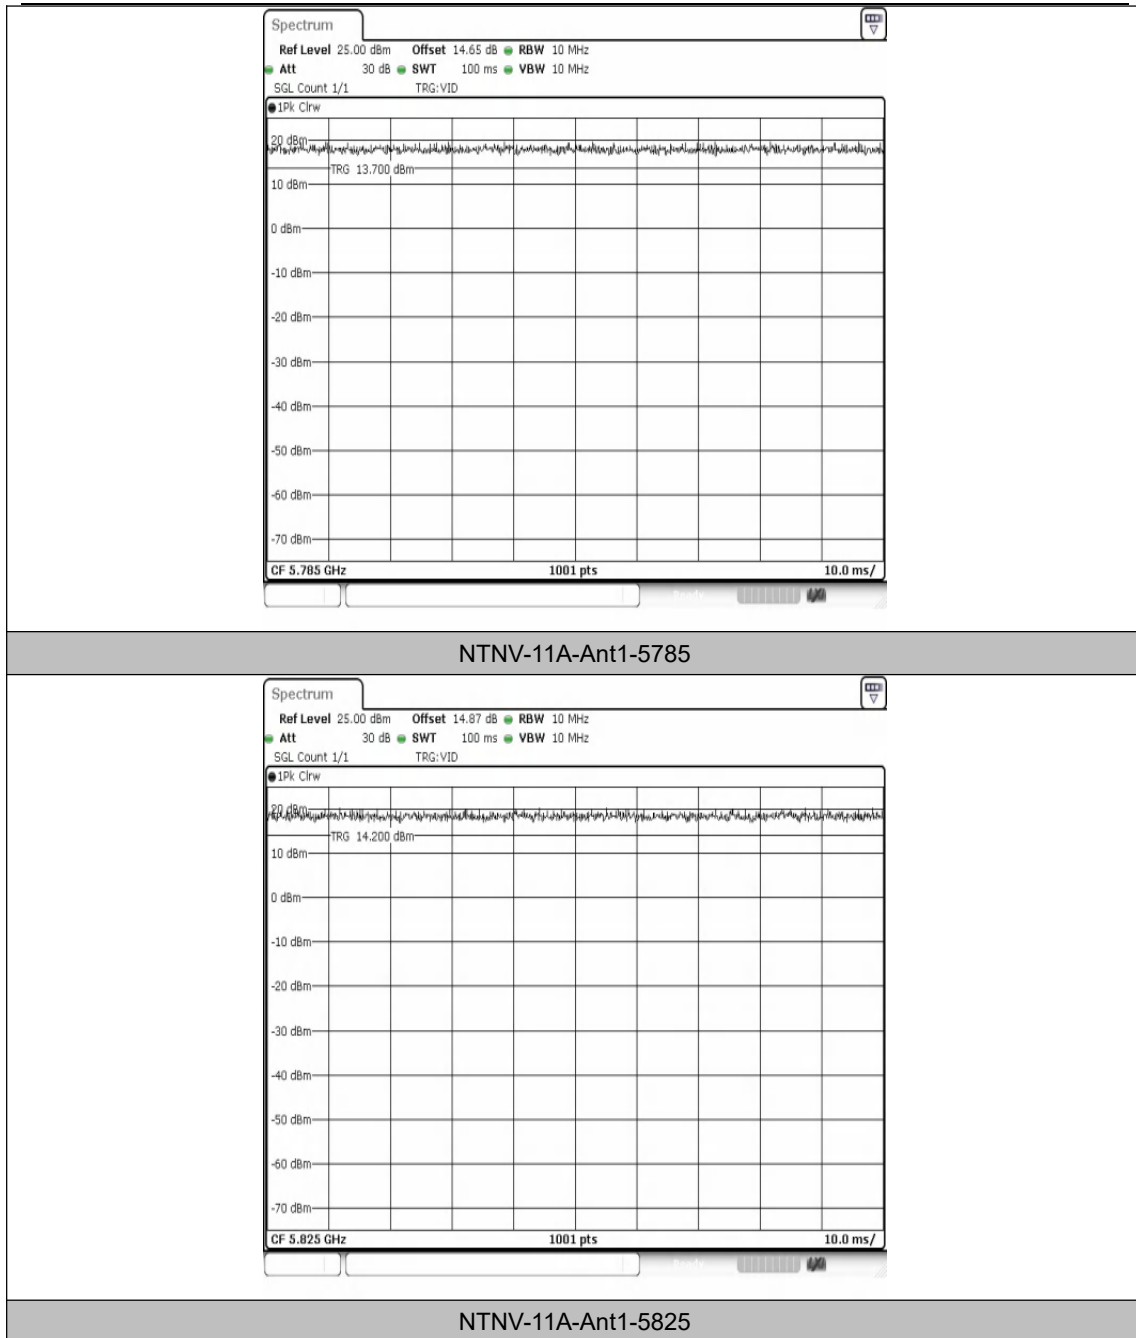

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

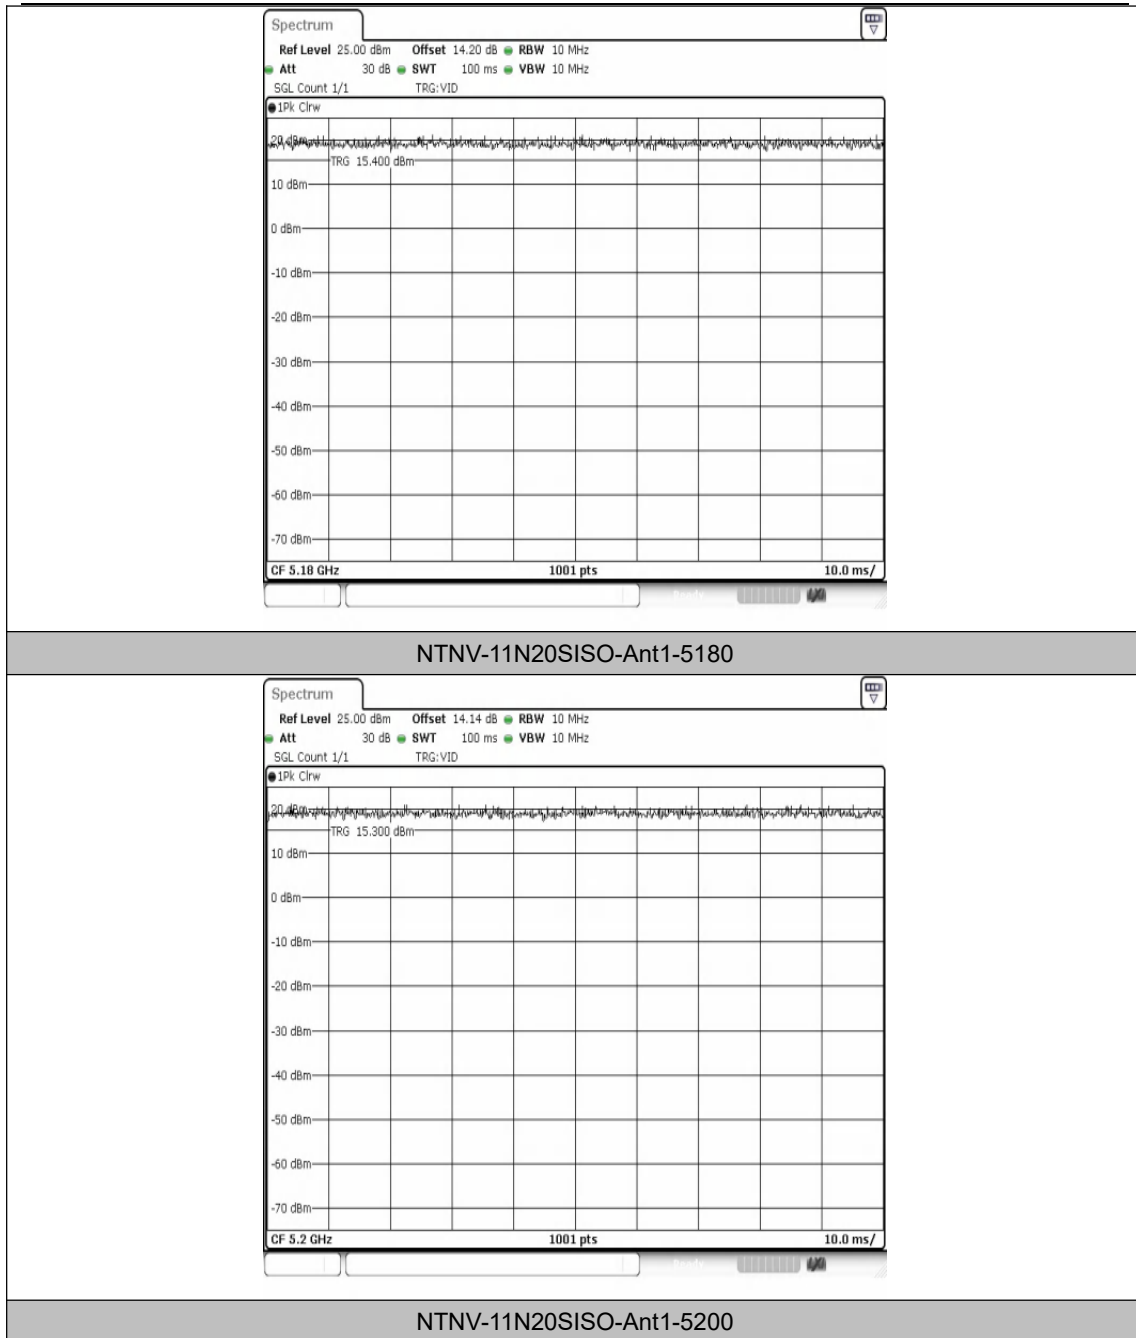

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel:(86)0755-26066440 Email:service@anbotek.com


 Hotline
 400-003-0500
www.anbotek.com

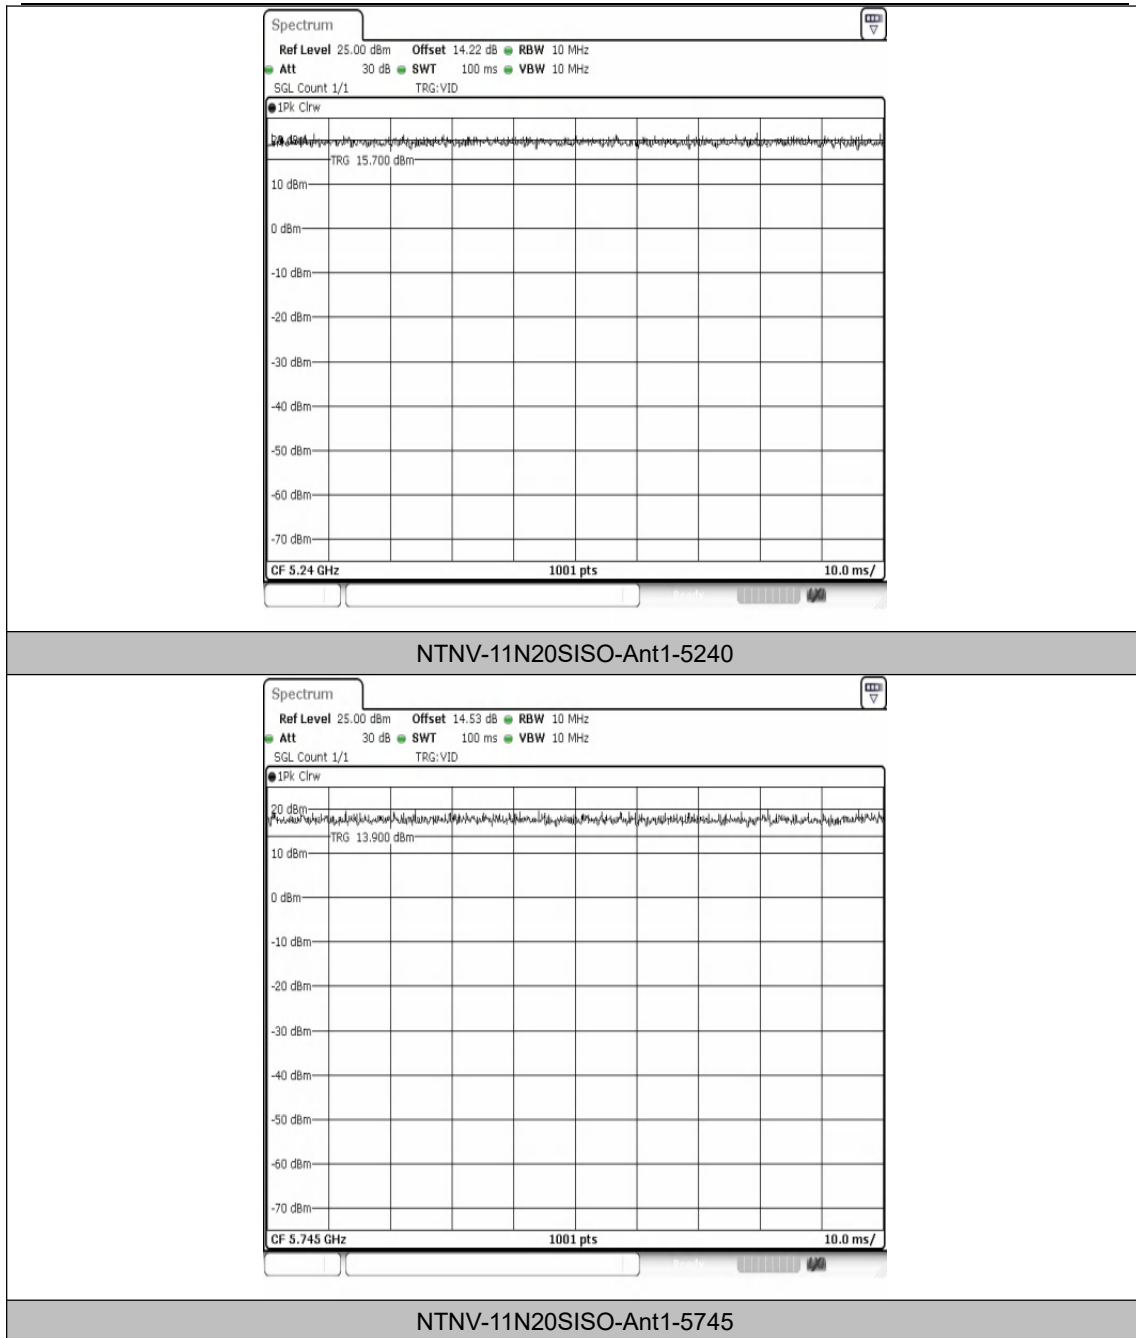

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel:(86)0755-26066440 Email:service@anbotek.com


 **Hotline**
 400-003-0500
www.anbotek.com

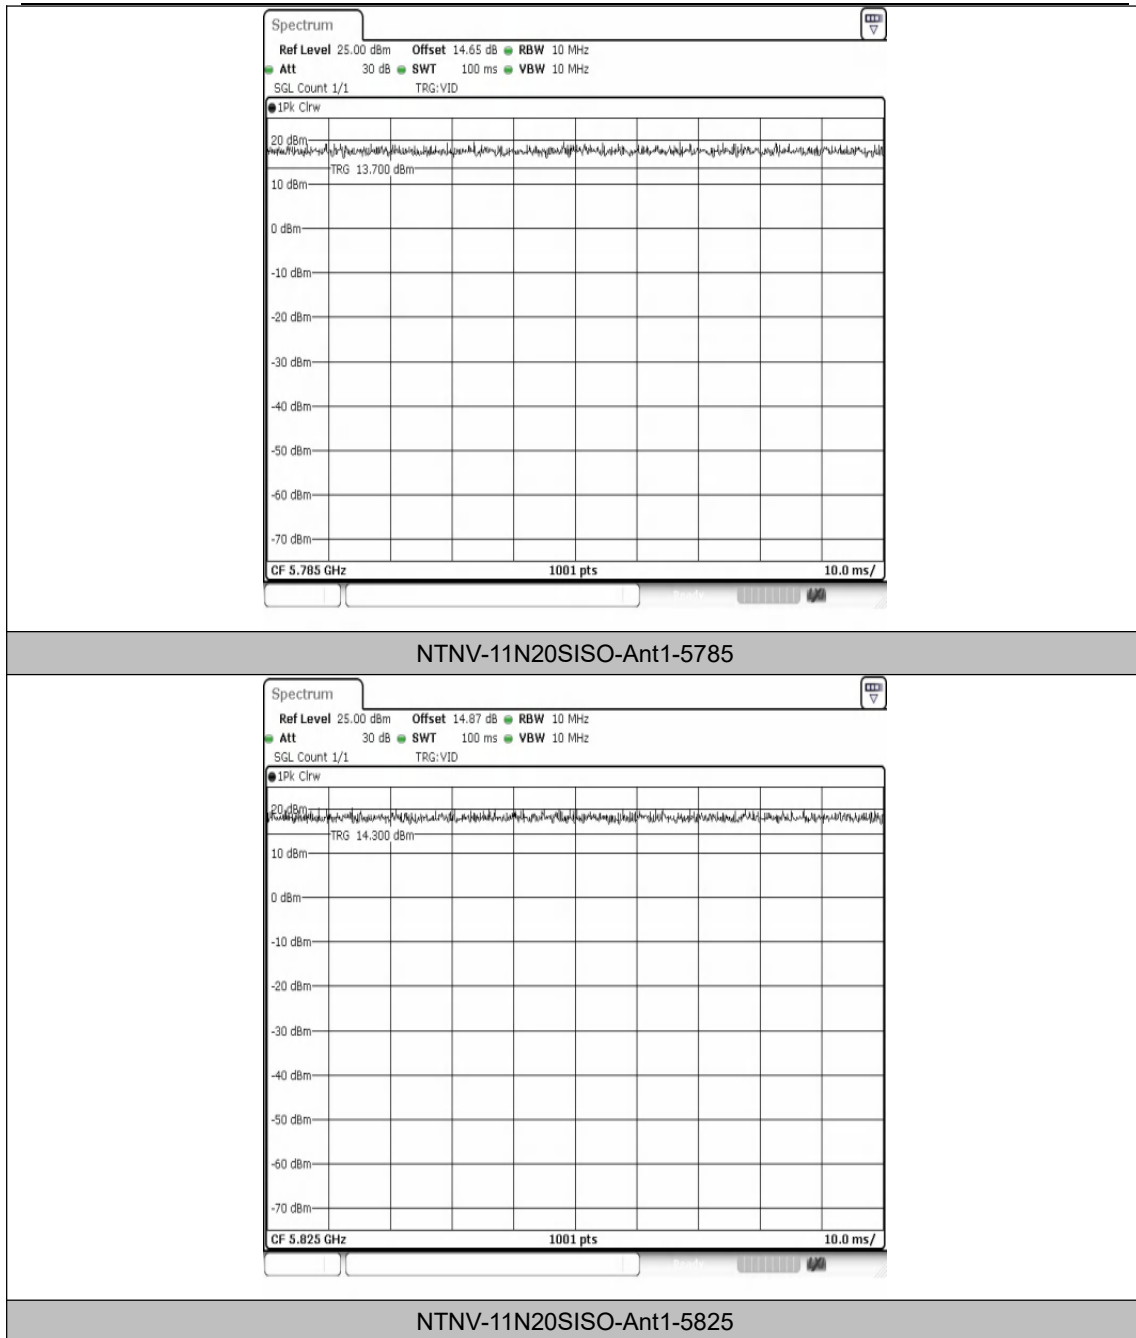

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel:(86)0755-26066440 Email:service@anbotek.com


 Hotline
 400-003-0500
www.anbotek.com

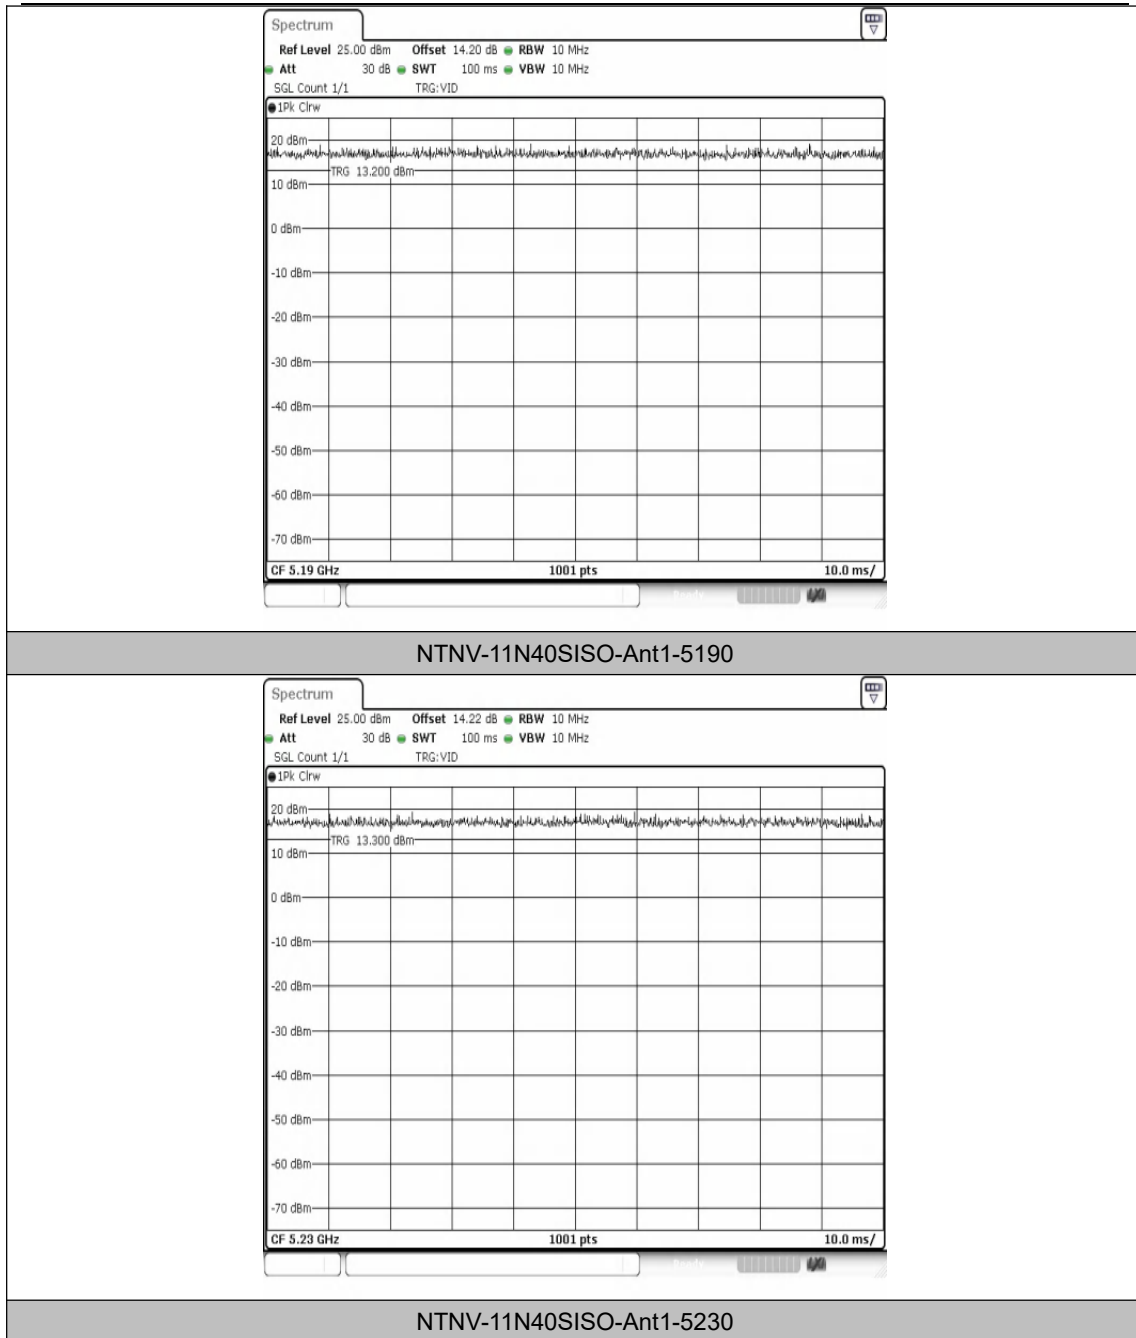


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

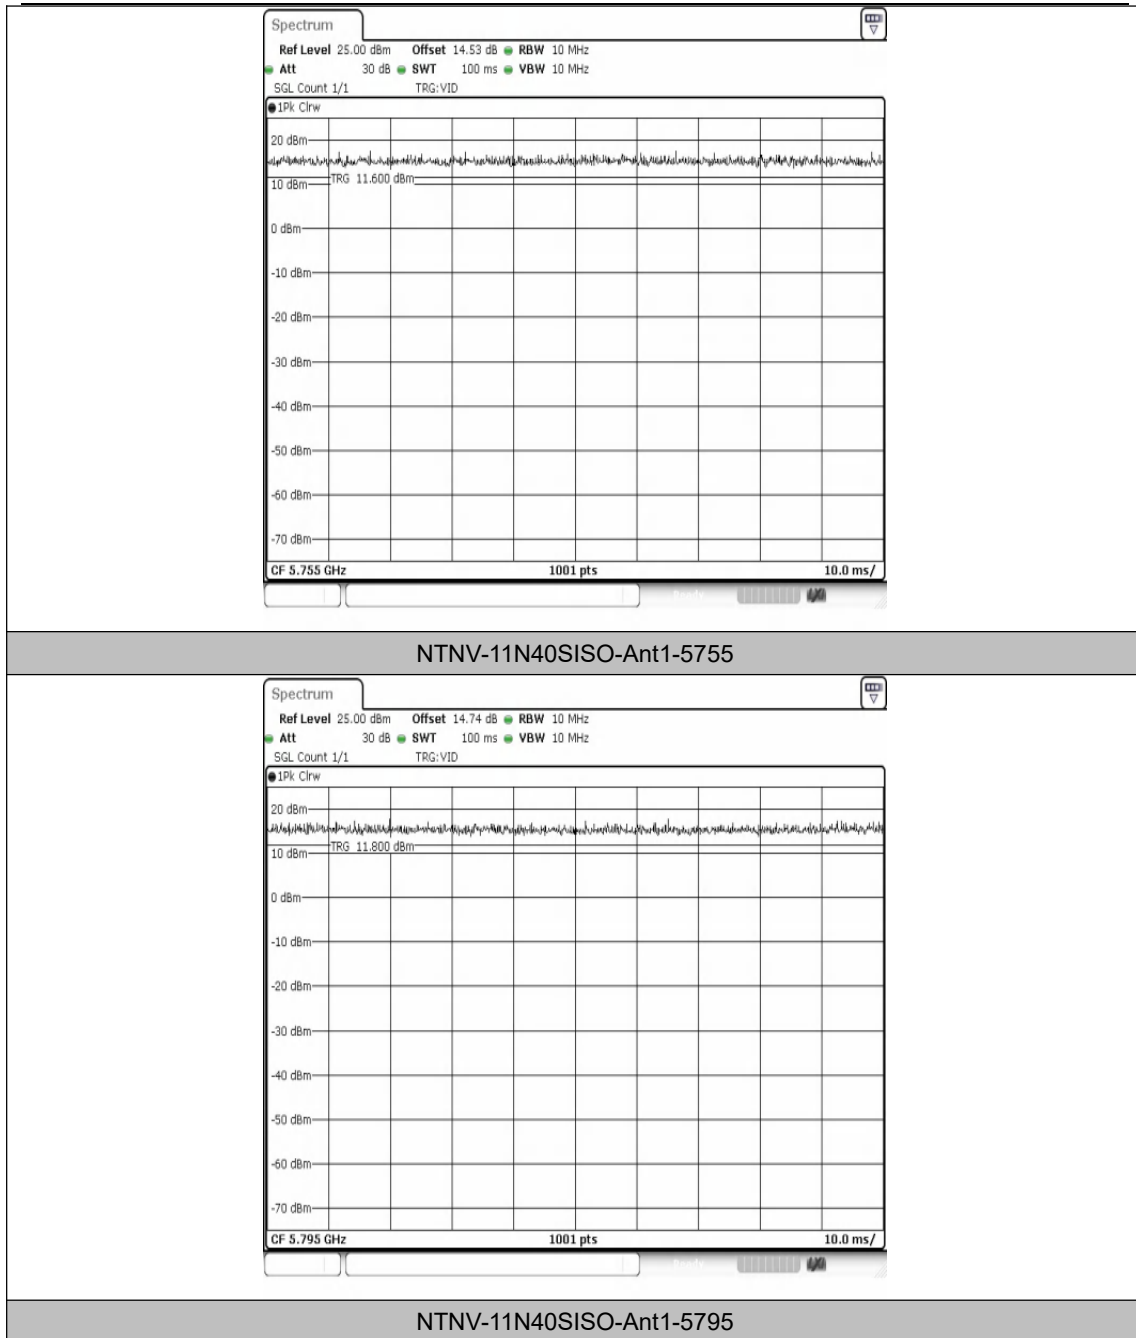


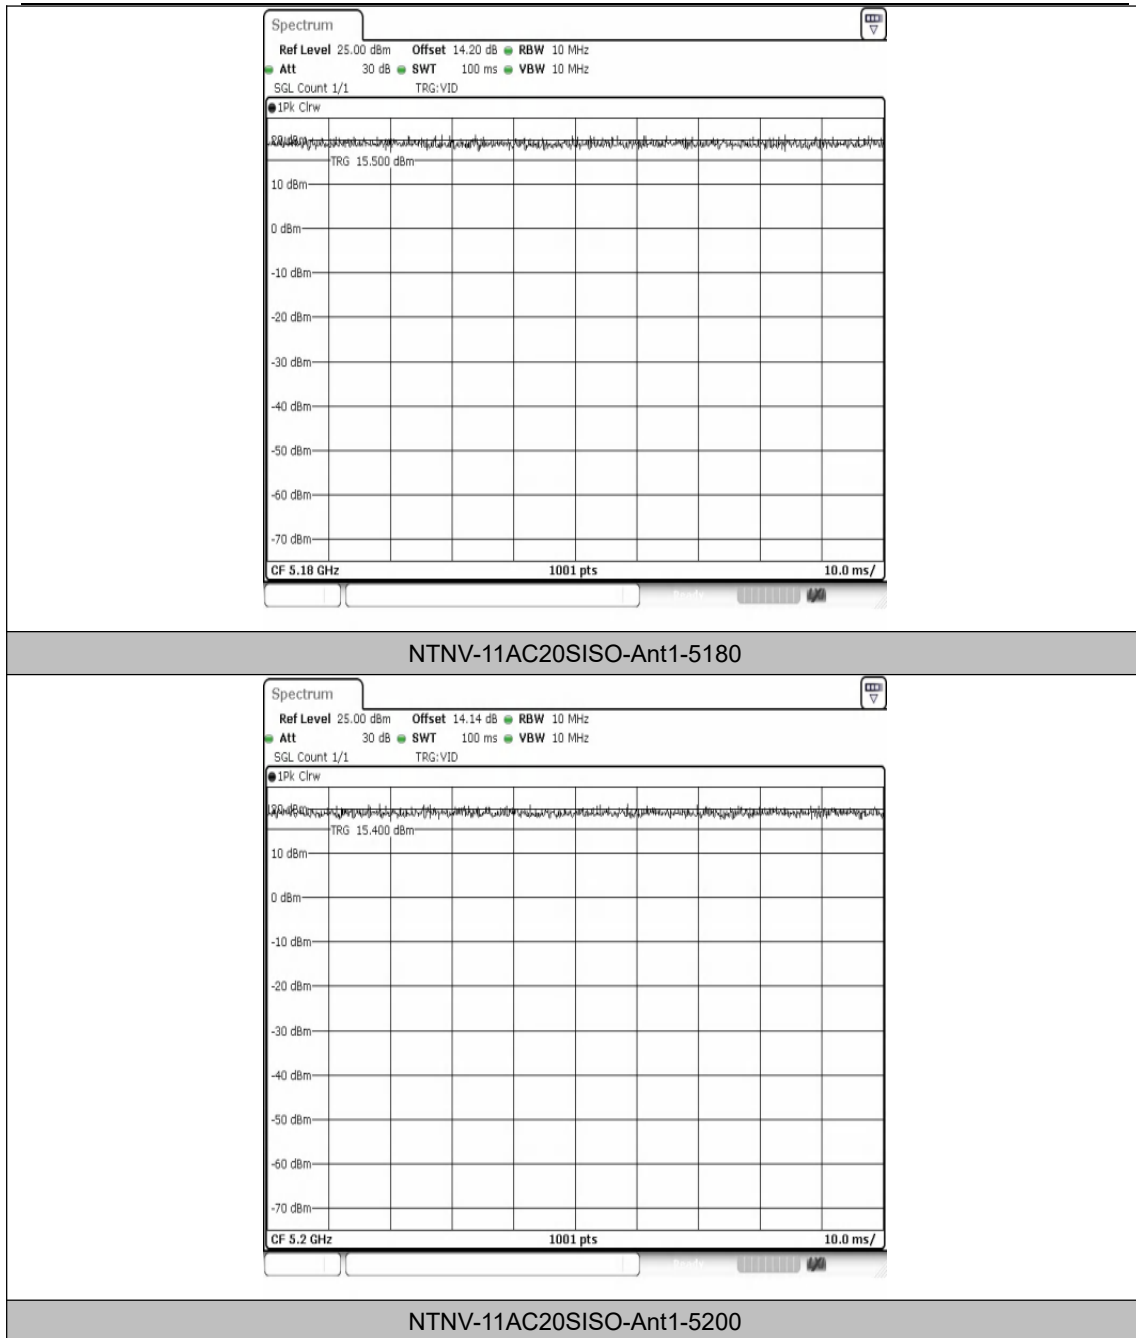


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel:(86)0755-26066440 Email:service@anbotek.com

 Hotline
 400-003-0500
www.anbotek.com

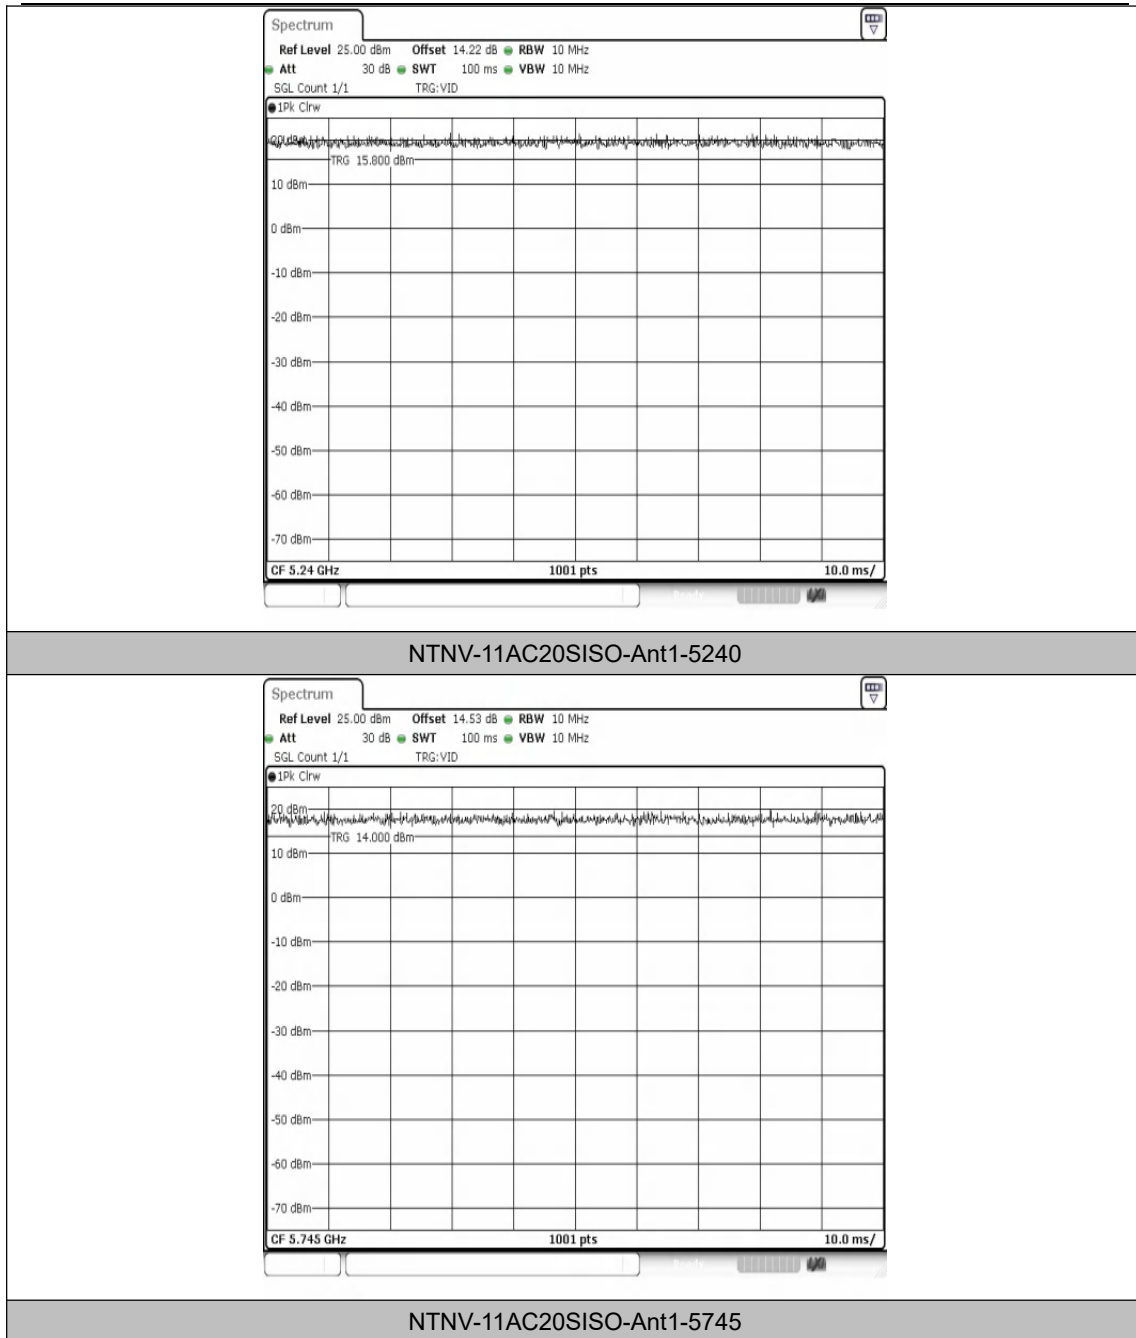


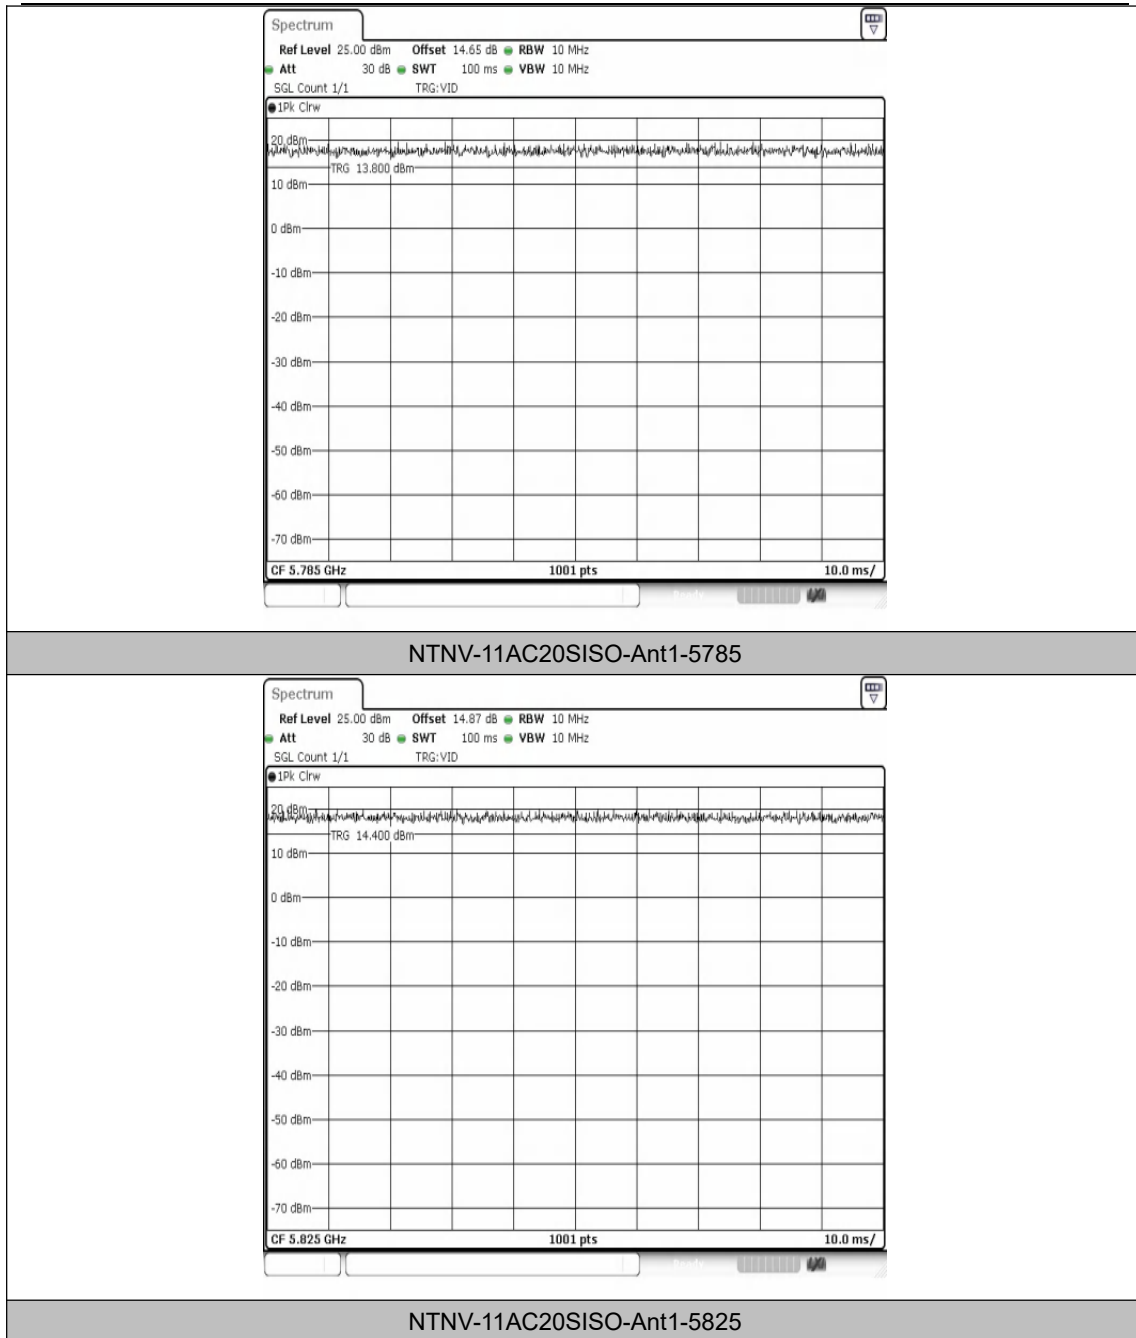

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

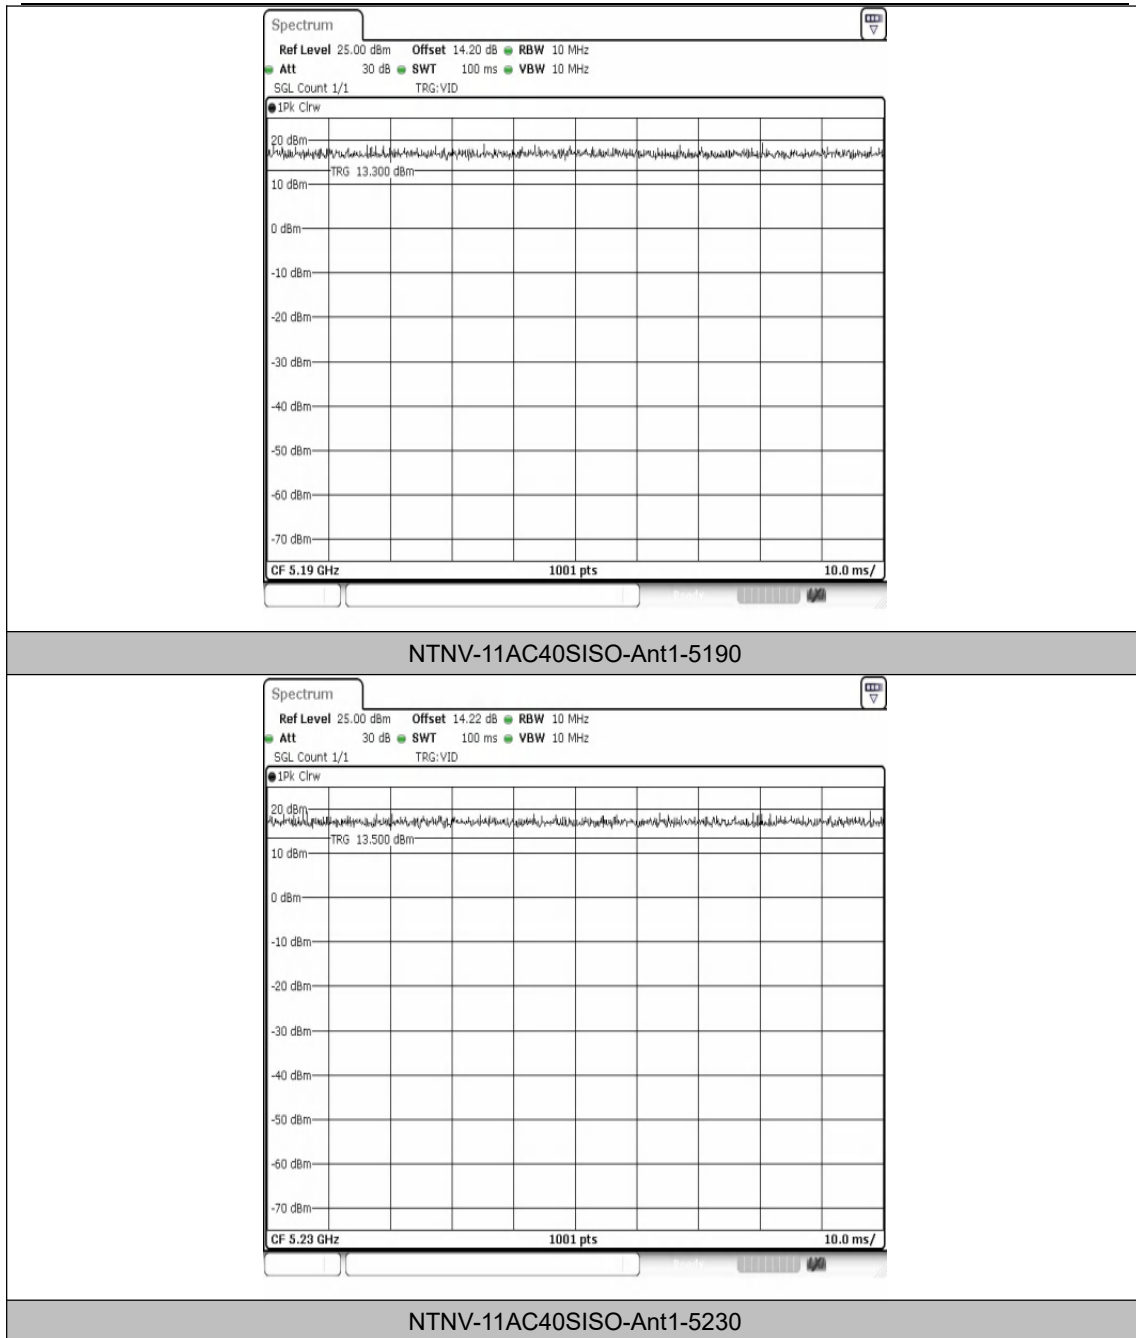

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

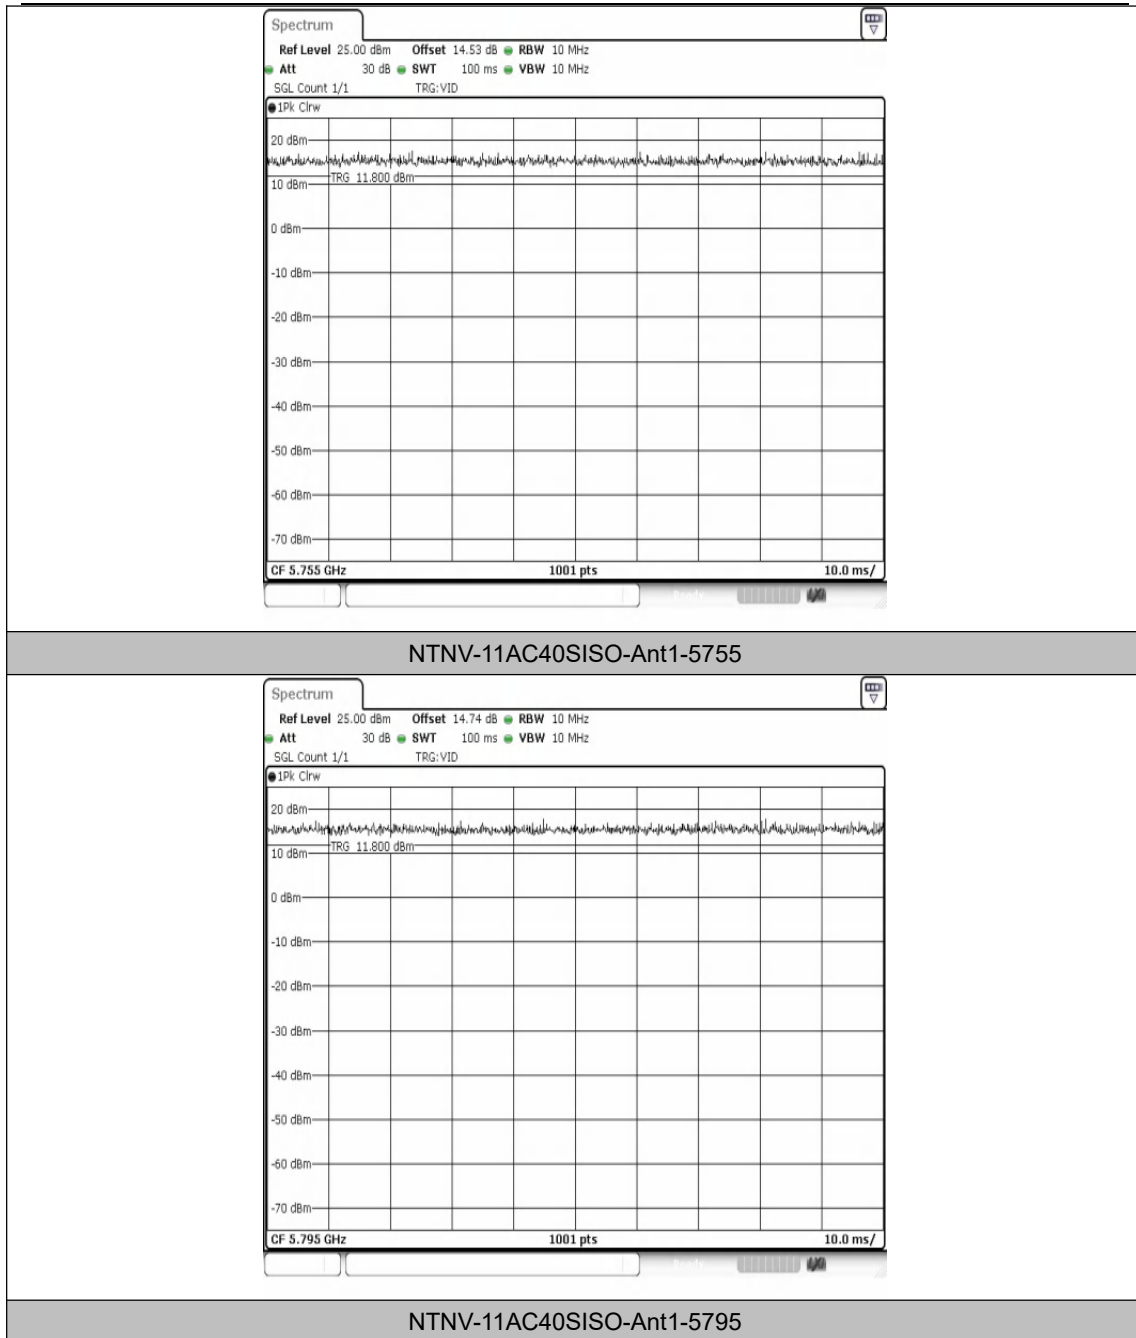

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

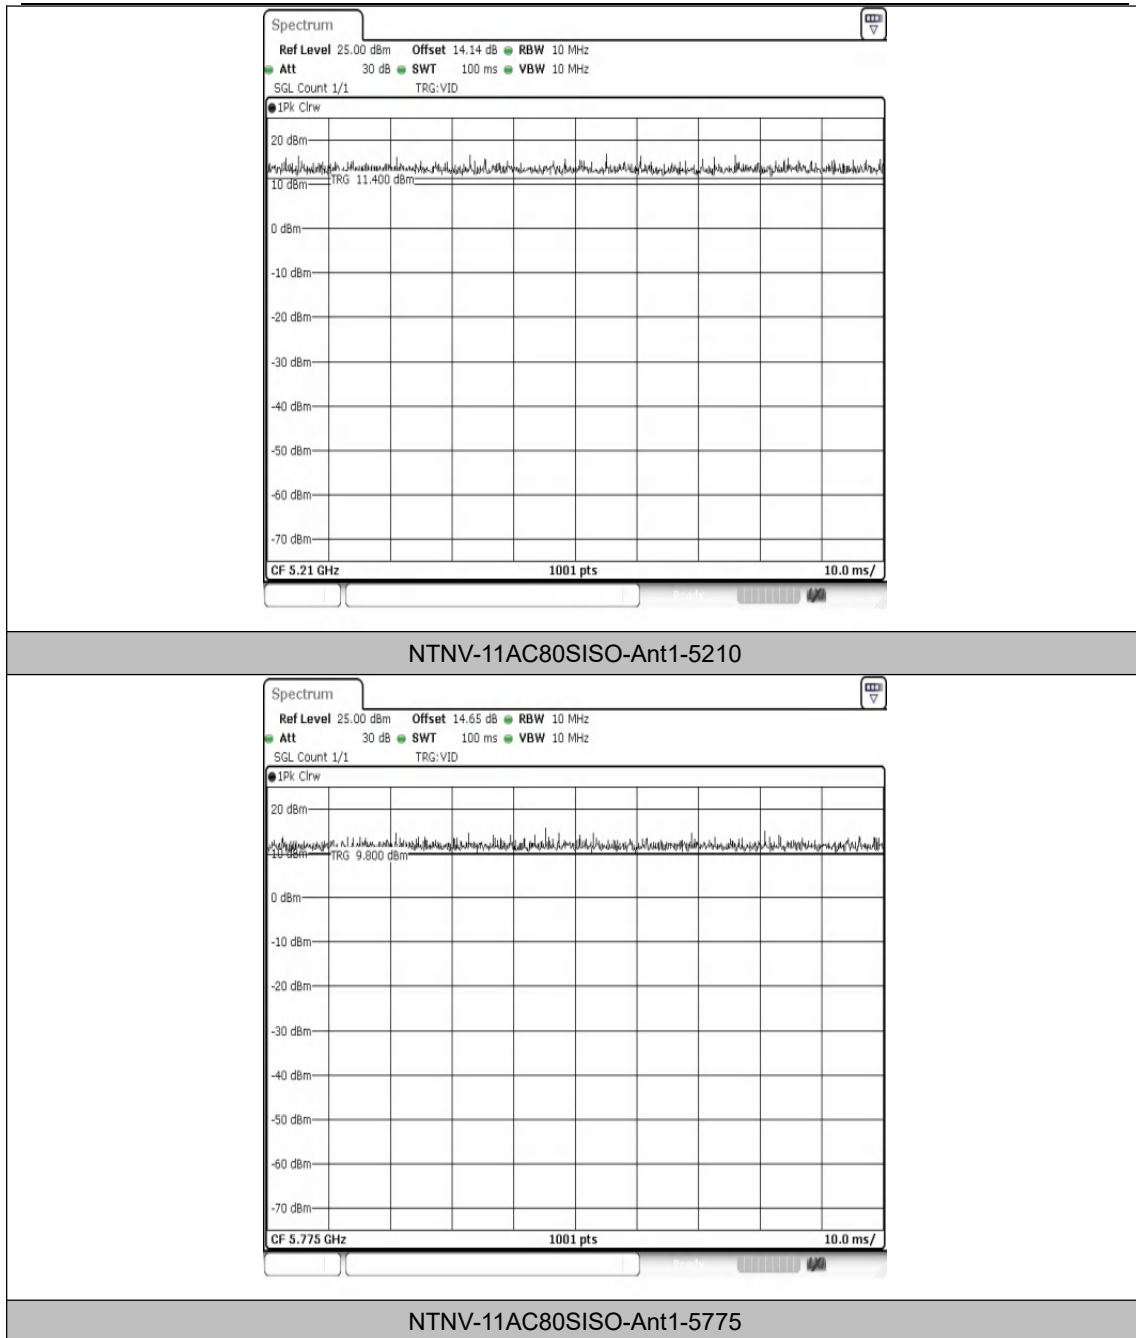

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency [MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	11.43	100.00	0.00	11.43	≤23.98	PASS
11A	Ant1	5200	11.68	100.00	0.00	11.68	≤23.98	PASS
11A	Ant1	5240	12.05	100.00	0.00	12.05	≤23.98	PASS
11A	Ant1	5745	11.34	100.00	0.00	11.34	≤30.00	PASS
11A	Ant1	5785	11.23	100.00	0.00	11.23	≤30.00	PASS
11A	Ant1	5825	11.77	100.00	0.00	11.77	≤30.00	PASS
11N20SISO	Ant1	5180	12.63	100.00	0.00	12.63	≤23.98	PASS
11N20SISO	Ant1	5200	12.65	100.00	0.00	12.65	≤23.98	PASS
11N20SISO	Ant1	5240	13.08	100.00	0.00	13.08	≤23.98	PASS
11N20SISO	Ant1	5745	11.18	100.00	0.00	11.18	≤30.00	PASS
11N20SISO	Ant1	5785	11.12	100.00	0.00	11.12	≤30.00	PASS
11N20SISO	Ant1	5825	11.56	100.00	0.00	11.56	≤30.00	PASS
11N40SISO	Ant1	5190	12.78	100.00	0.00	12.78	≤23.98	PASS
11N40SISO	Ant1	5230	12.94	100.00	0.00	12.94	≤23.98	PASS
11N40SISO	Ant1	5755	11.20	100.00	0.00	11.20	≤30.00	PASS
11N40SISO	Ant1	5795	11.29	100.00	0.00	11.29	≤30.00	PASS
11AC20SISO	Ant1	5180	12.65	100.00	0.00	12.65	≤23.98	PASS
11AC20SISO	Ant1	5200	12.76	100.00	0.00	12.76	≤23.98	PASS
11AC20SISO	Ant1	5240	13.01	100.00	0.00	13.01	≤23.98	PASS
11AC20SISO	Ant1	5745	11.19	100.00	0.00	11.19	≤30.00	PASS
11AC20SISO	Ant1	5785	11.12	100.00	0.00	11.12	≤30.00	PASS
11AC20SISO	Ant1	5825	11.60	100.00	0.00	11.60	≤30.00	PASS
11AC40SISO	Ant1	5190	12.79	100.00	0.00	12.79	≤23.98	PASS
11AC40SISO	Ant1	5230	12.98	100.00	0.00	12.98	≤23.98	PASS
11AC40SISO	Ant1	5755	11.12	100.00	0.00	11.12	≤30.00	PASS
11AC40SISO	Ant1	5795	11.32	100.00	0.00	11.32	≤30.00	PASS
11AC80SISO	Ant1	5210	12.63	100.00	0.00	12.63	≤23.98	PASS
11AC80SISO	Ant1	5775	11.06	100.00	0.00	11.06	≤30.00	PASS

Note: 1.The cable loss are compensated in the graph.


Test Graphs Channel Power

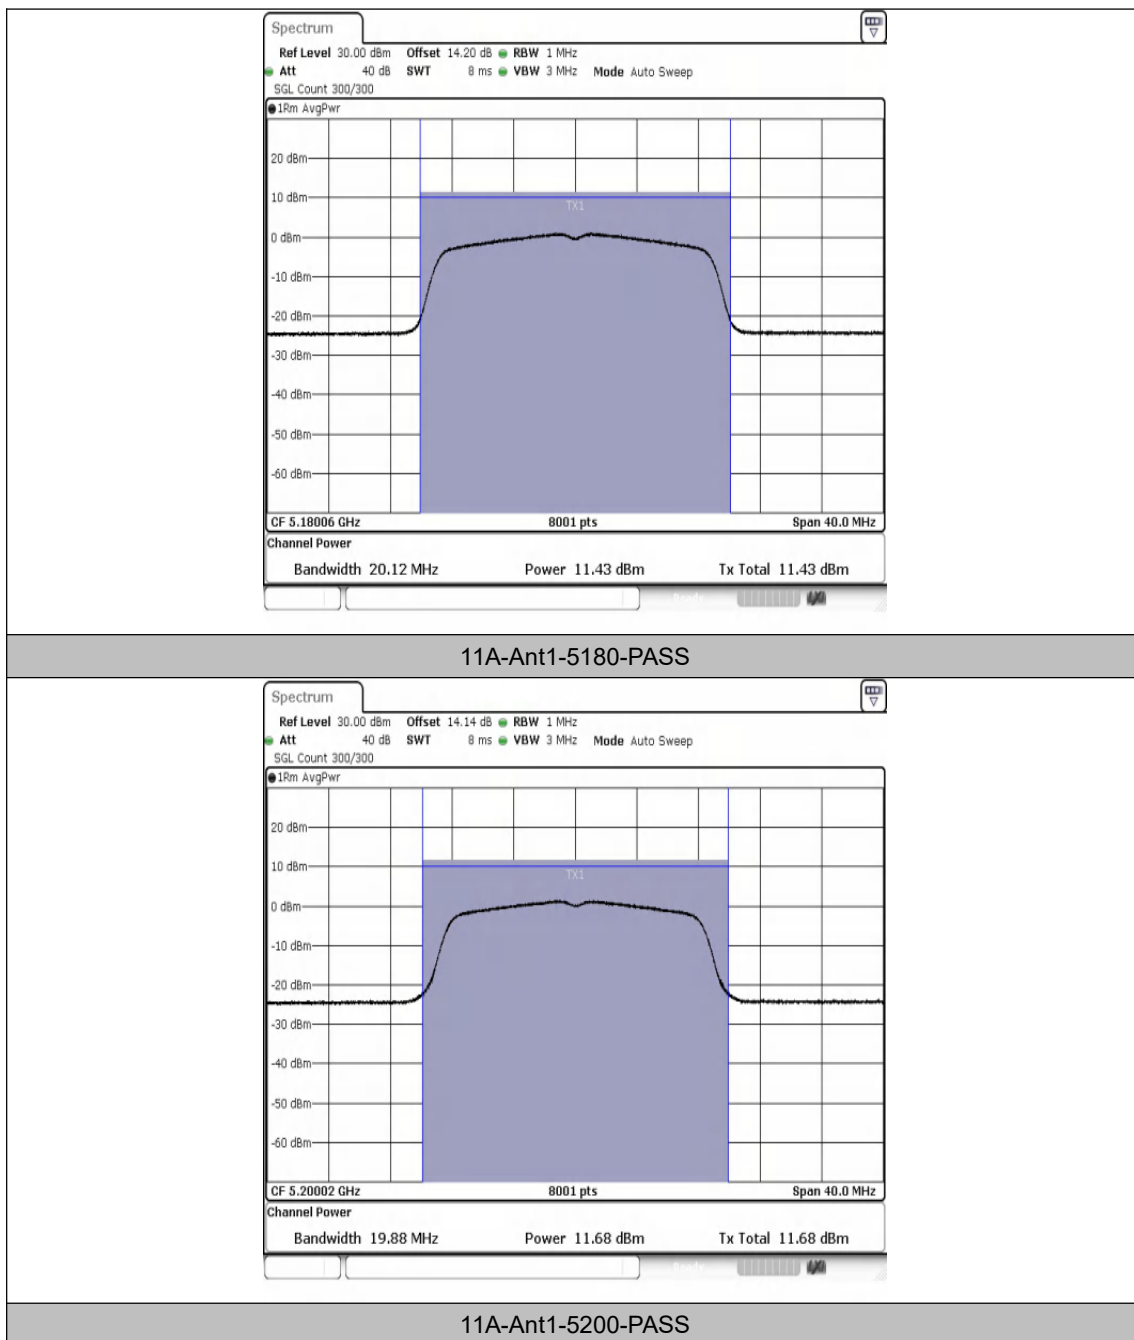

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

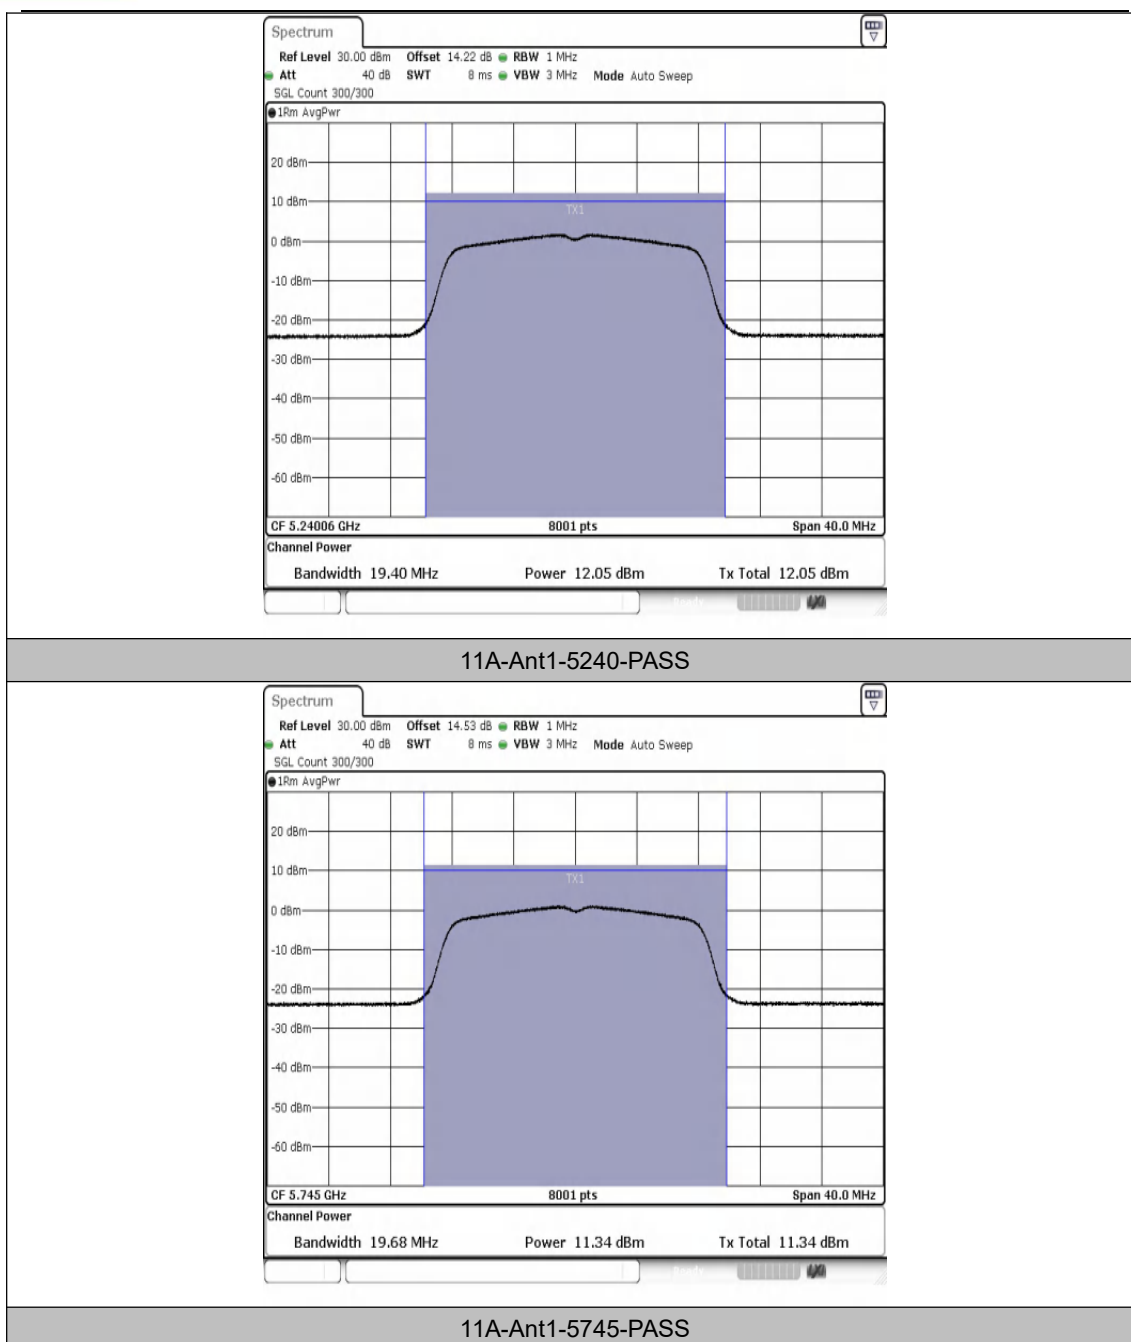


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

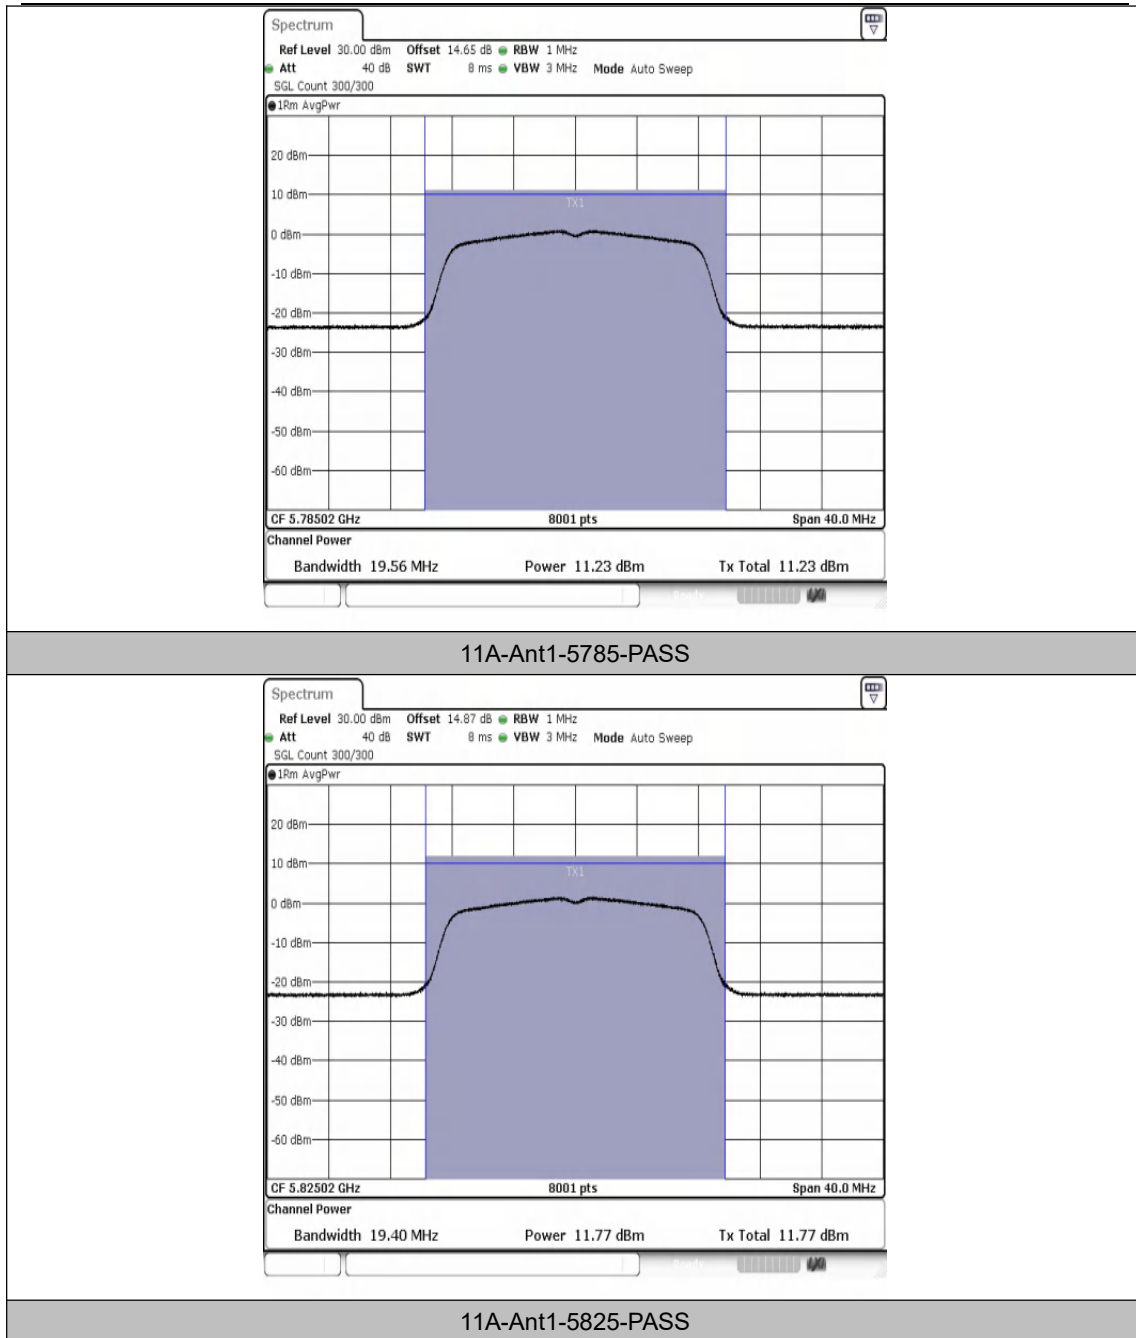


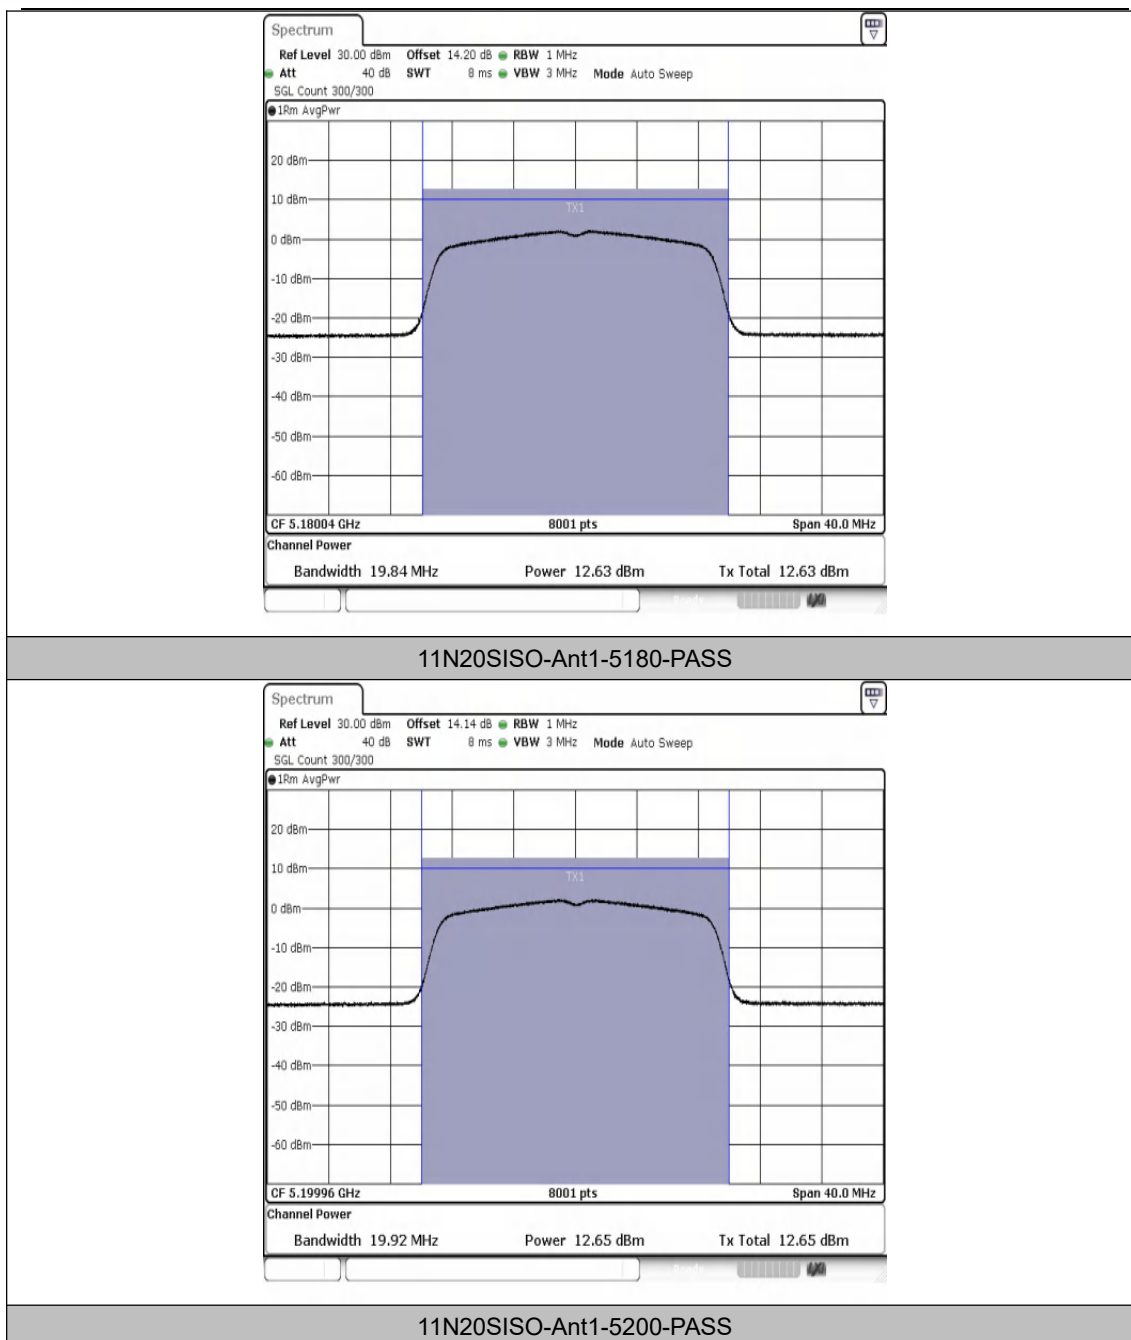

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

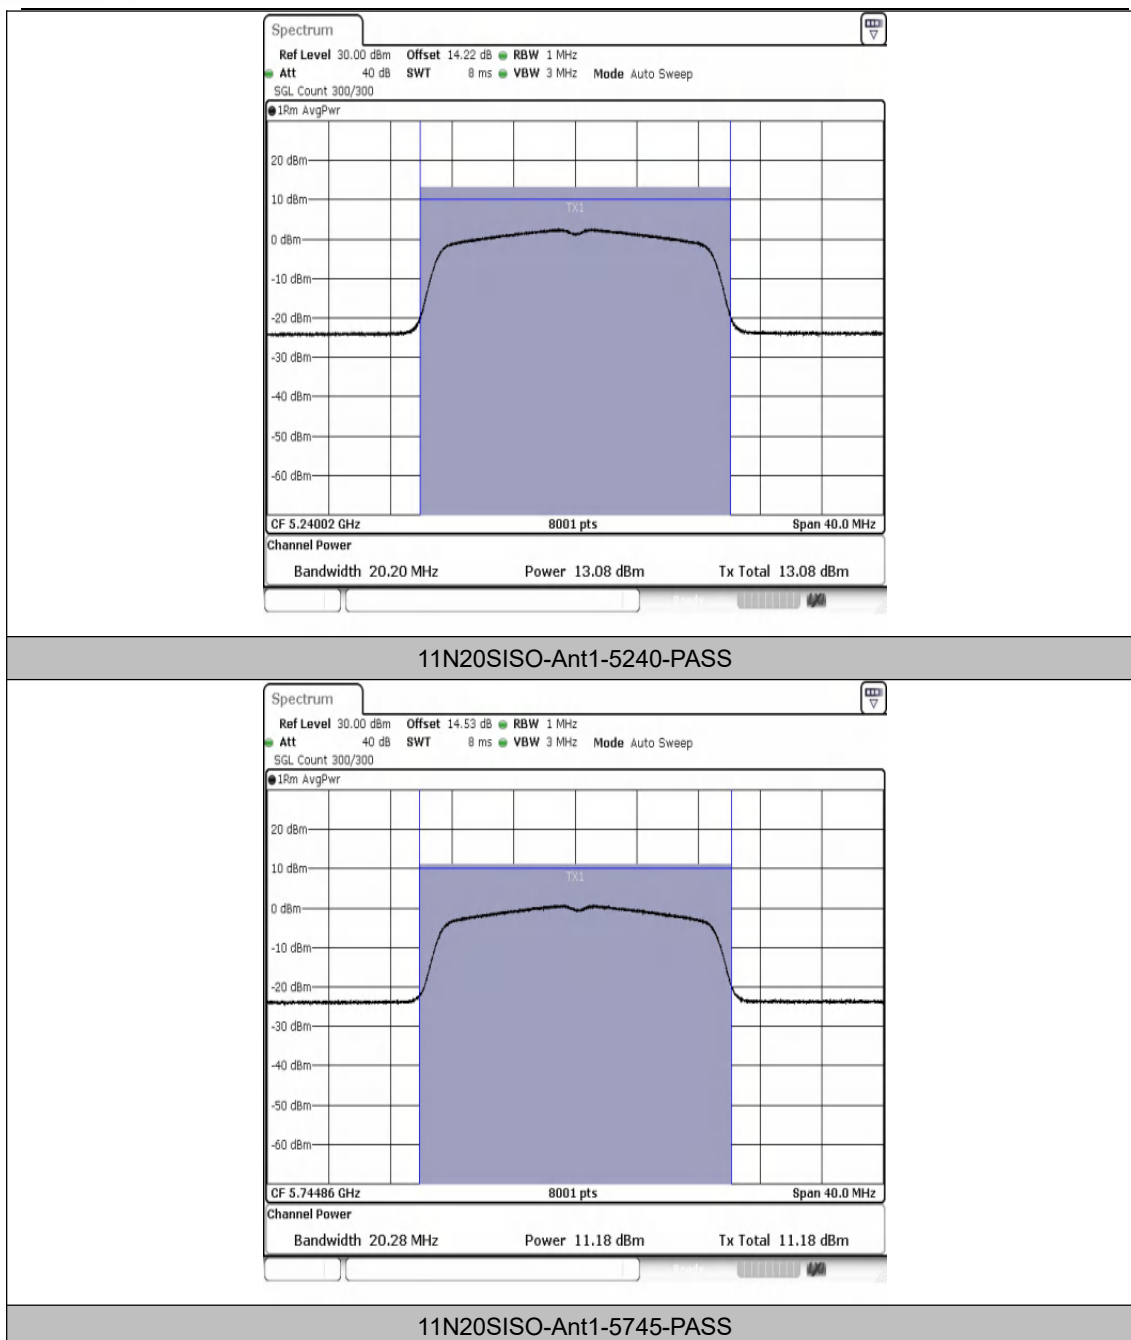

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

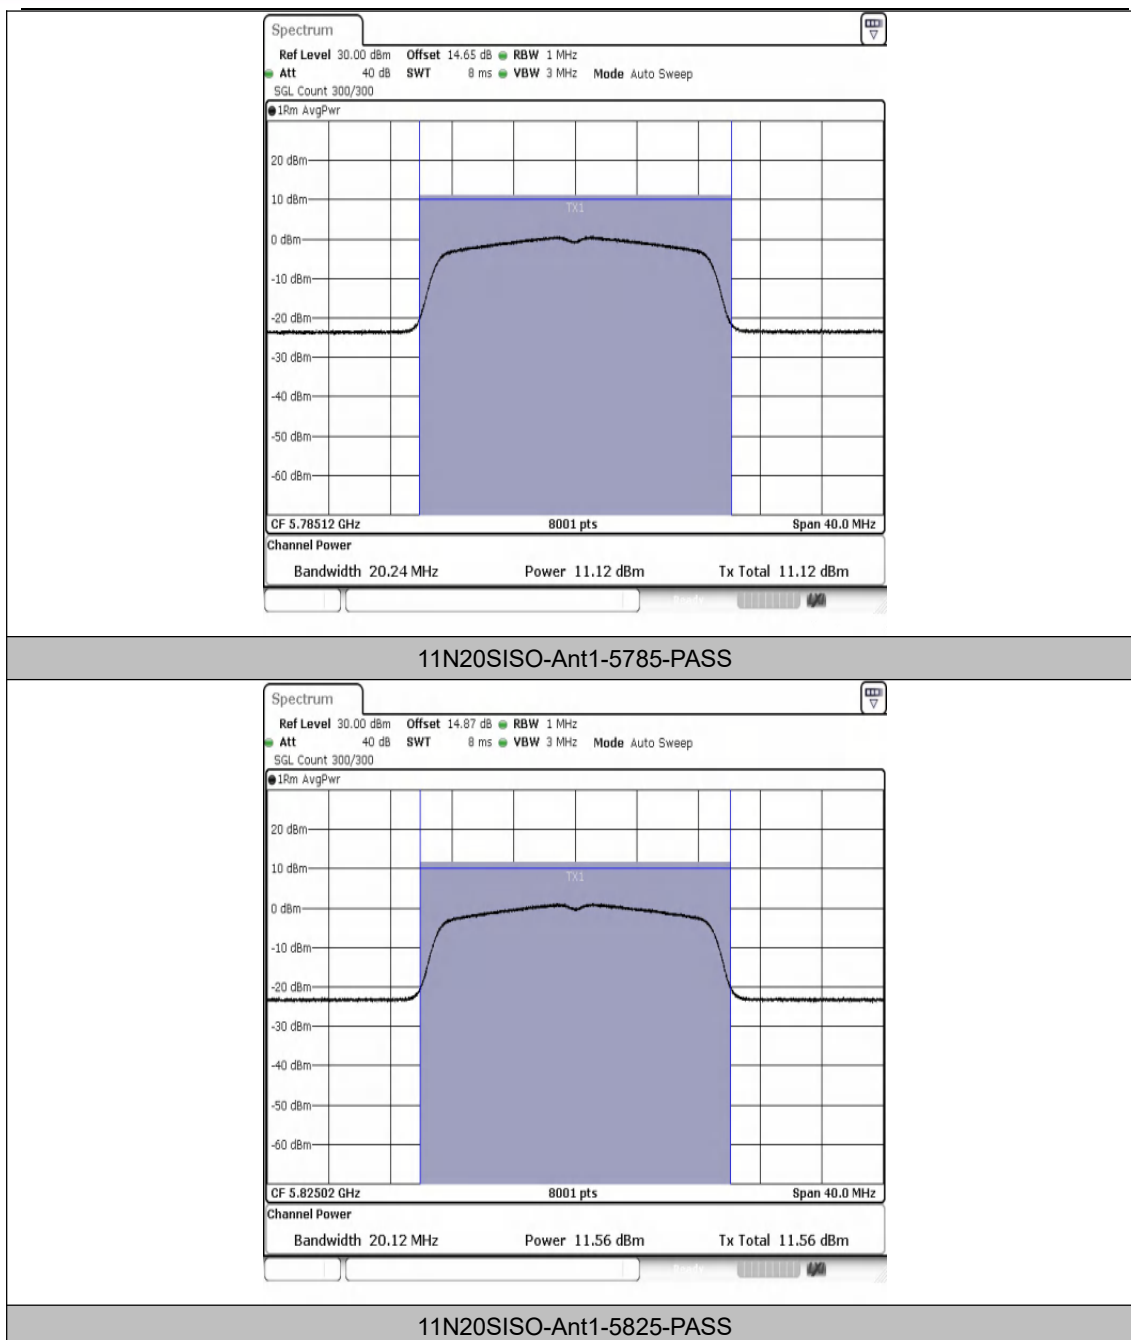

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

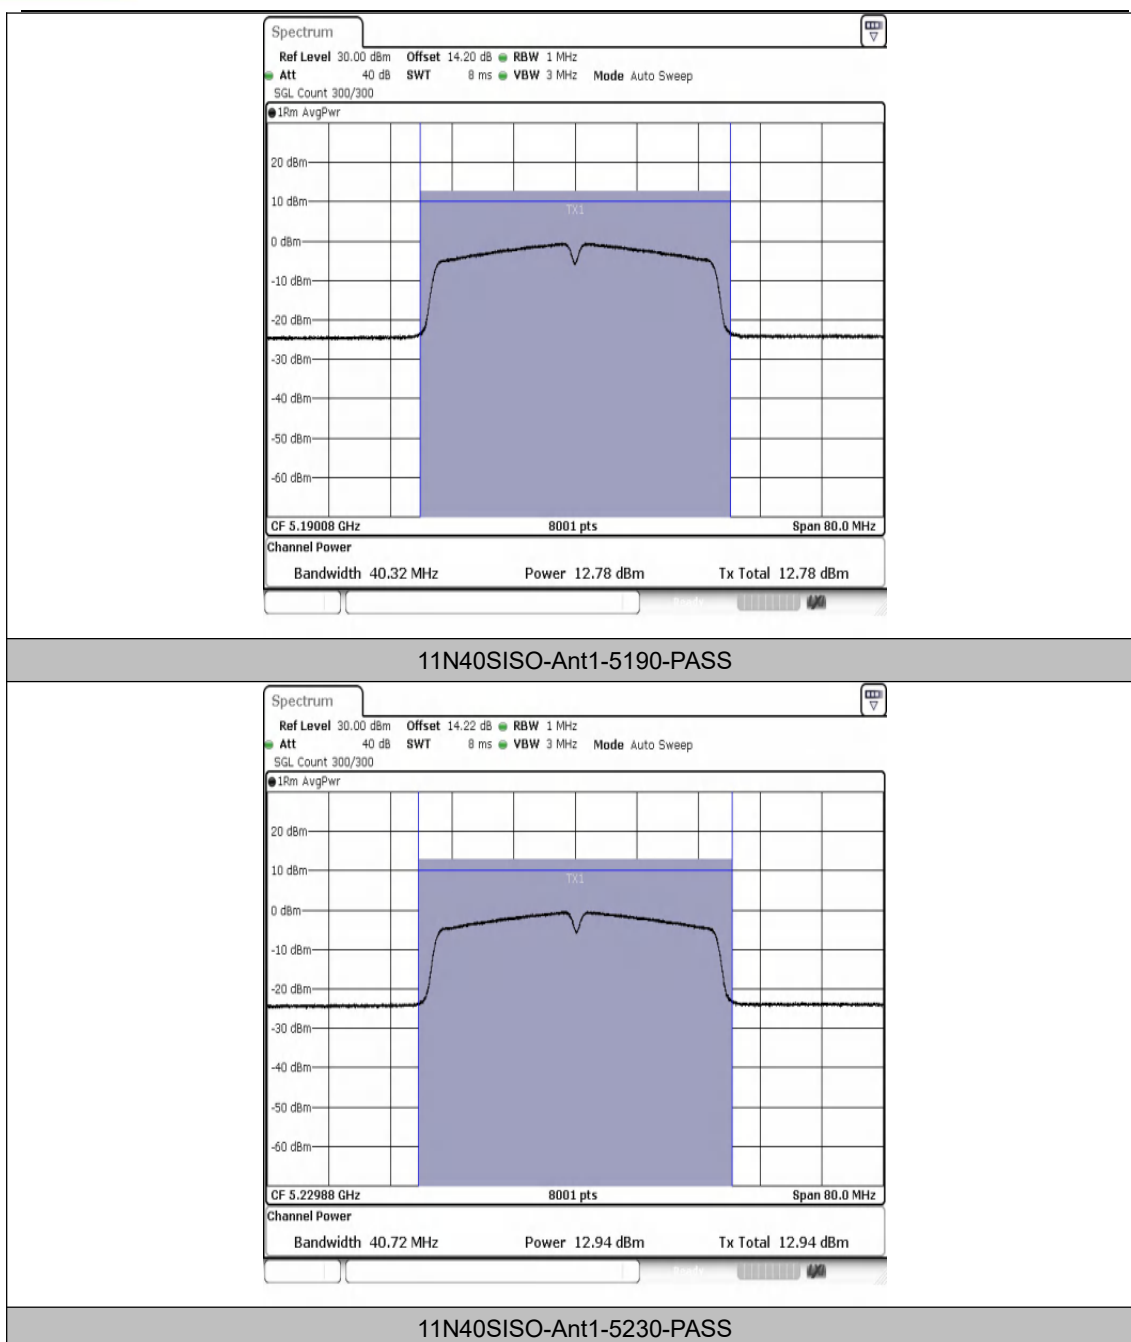

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

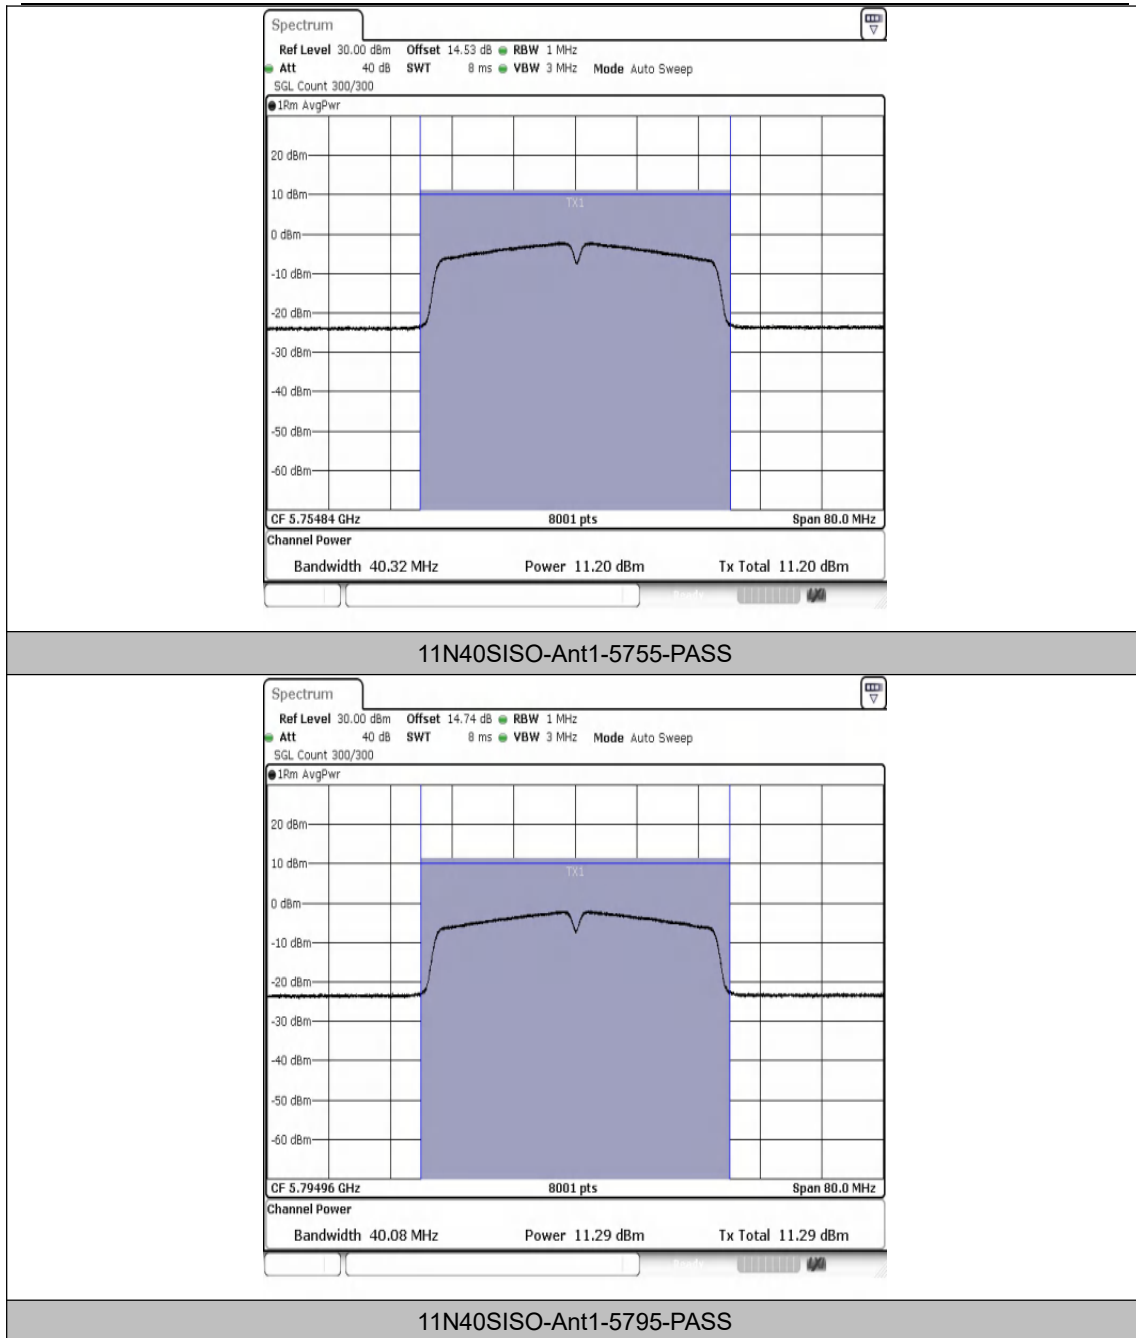

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


 Hotline
400-003-0500
www.anbotek.com

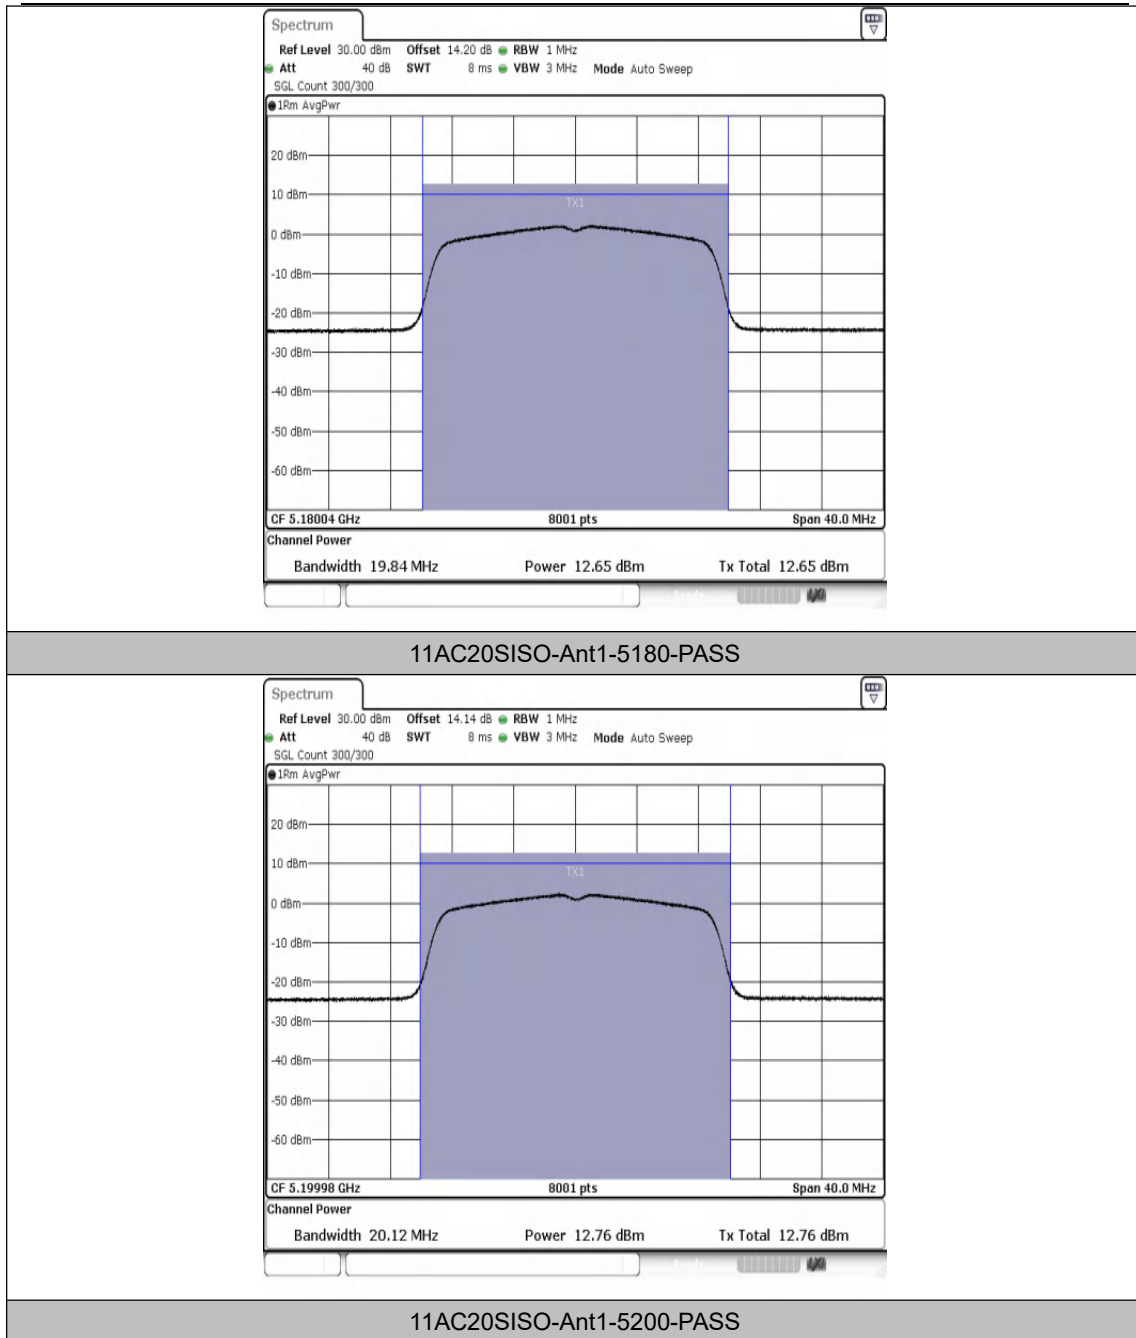


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

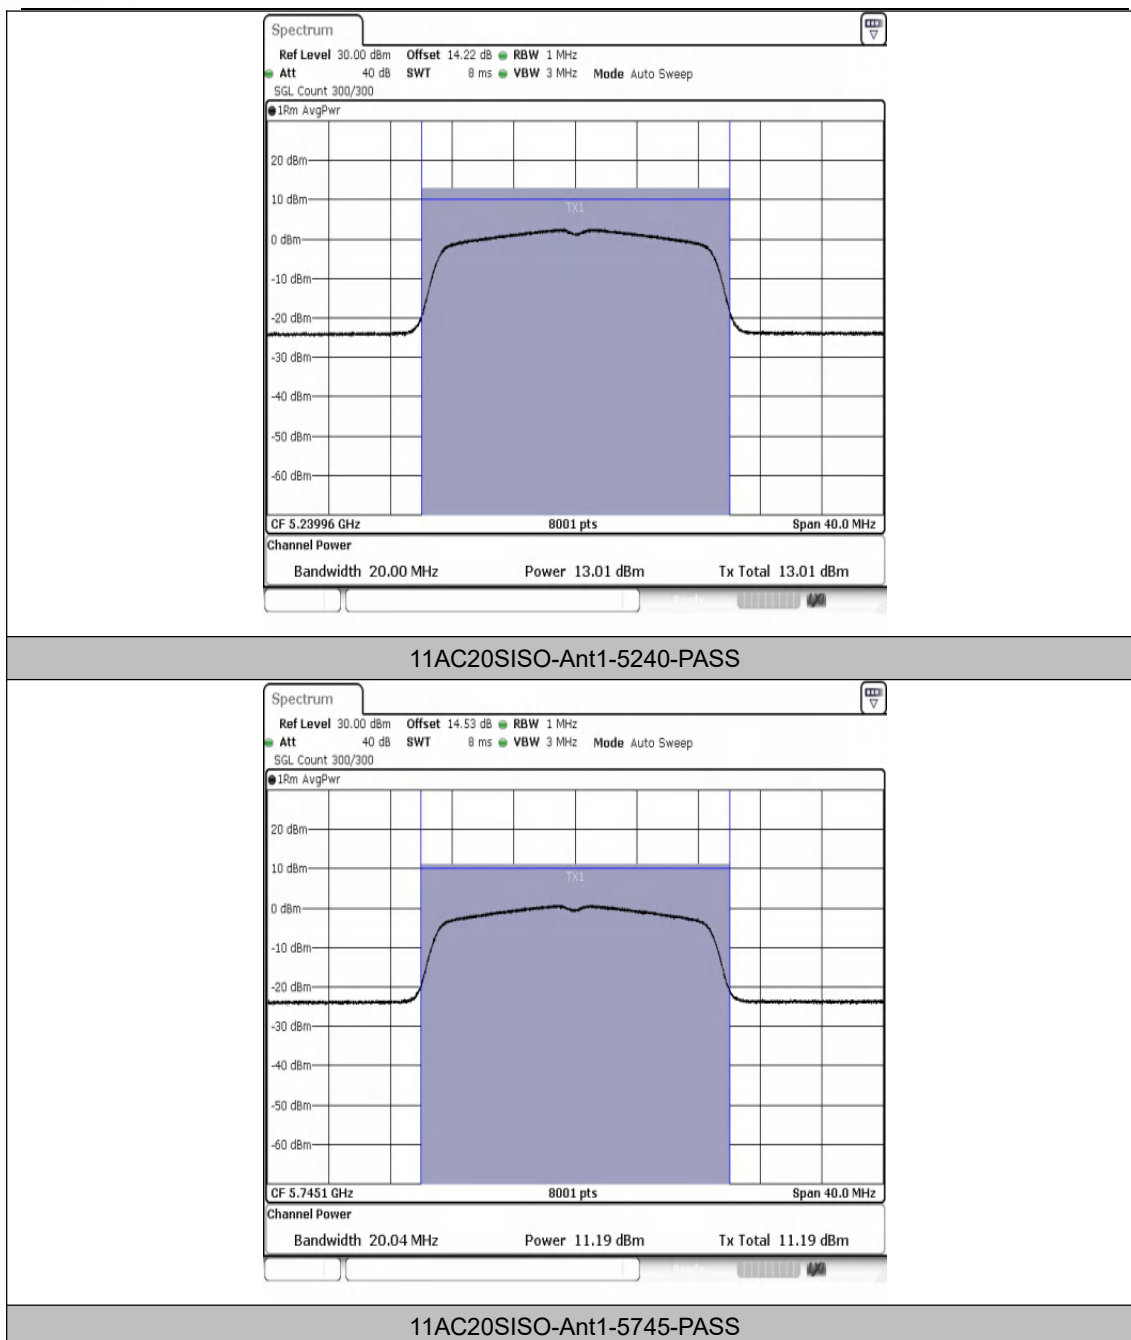


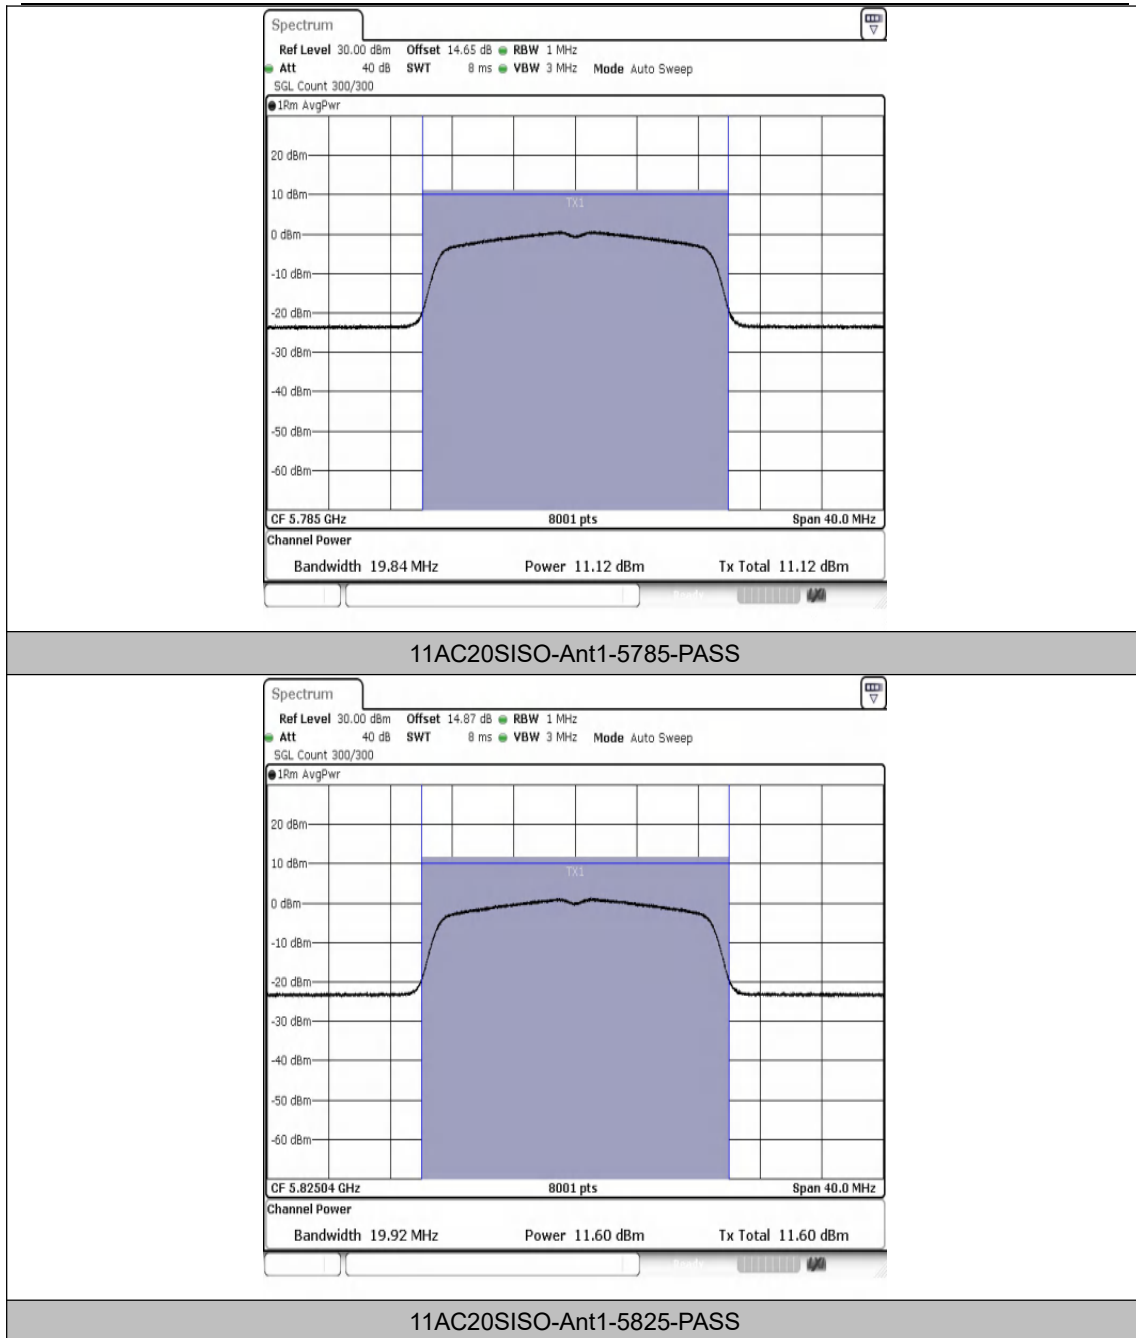

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

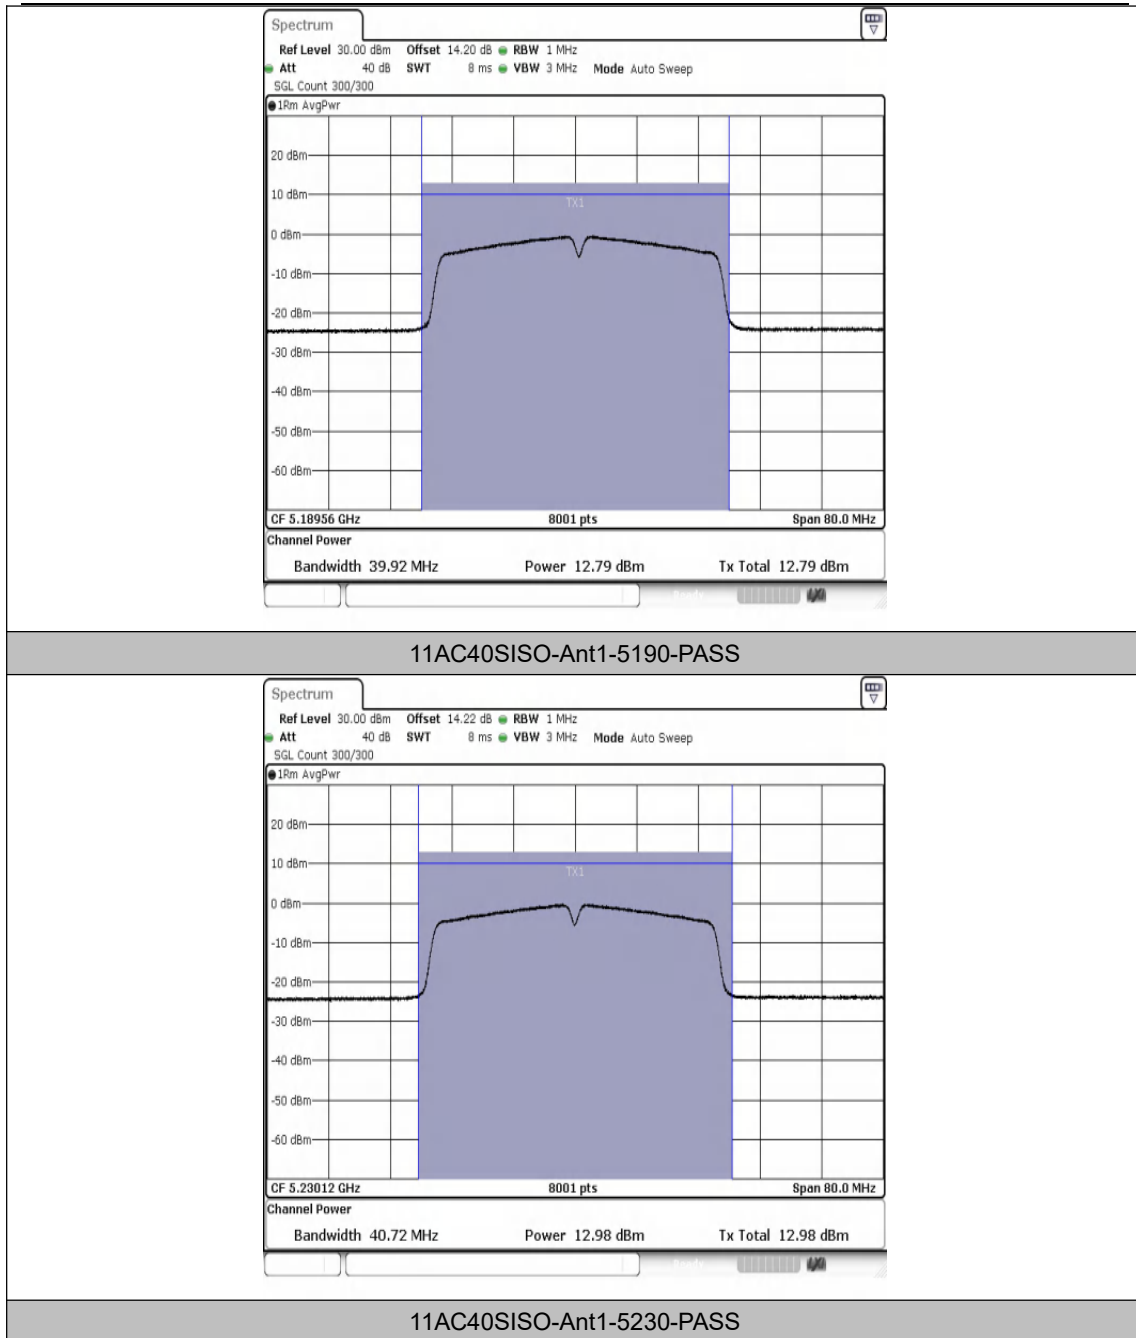

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

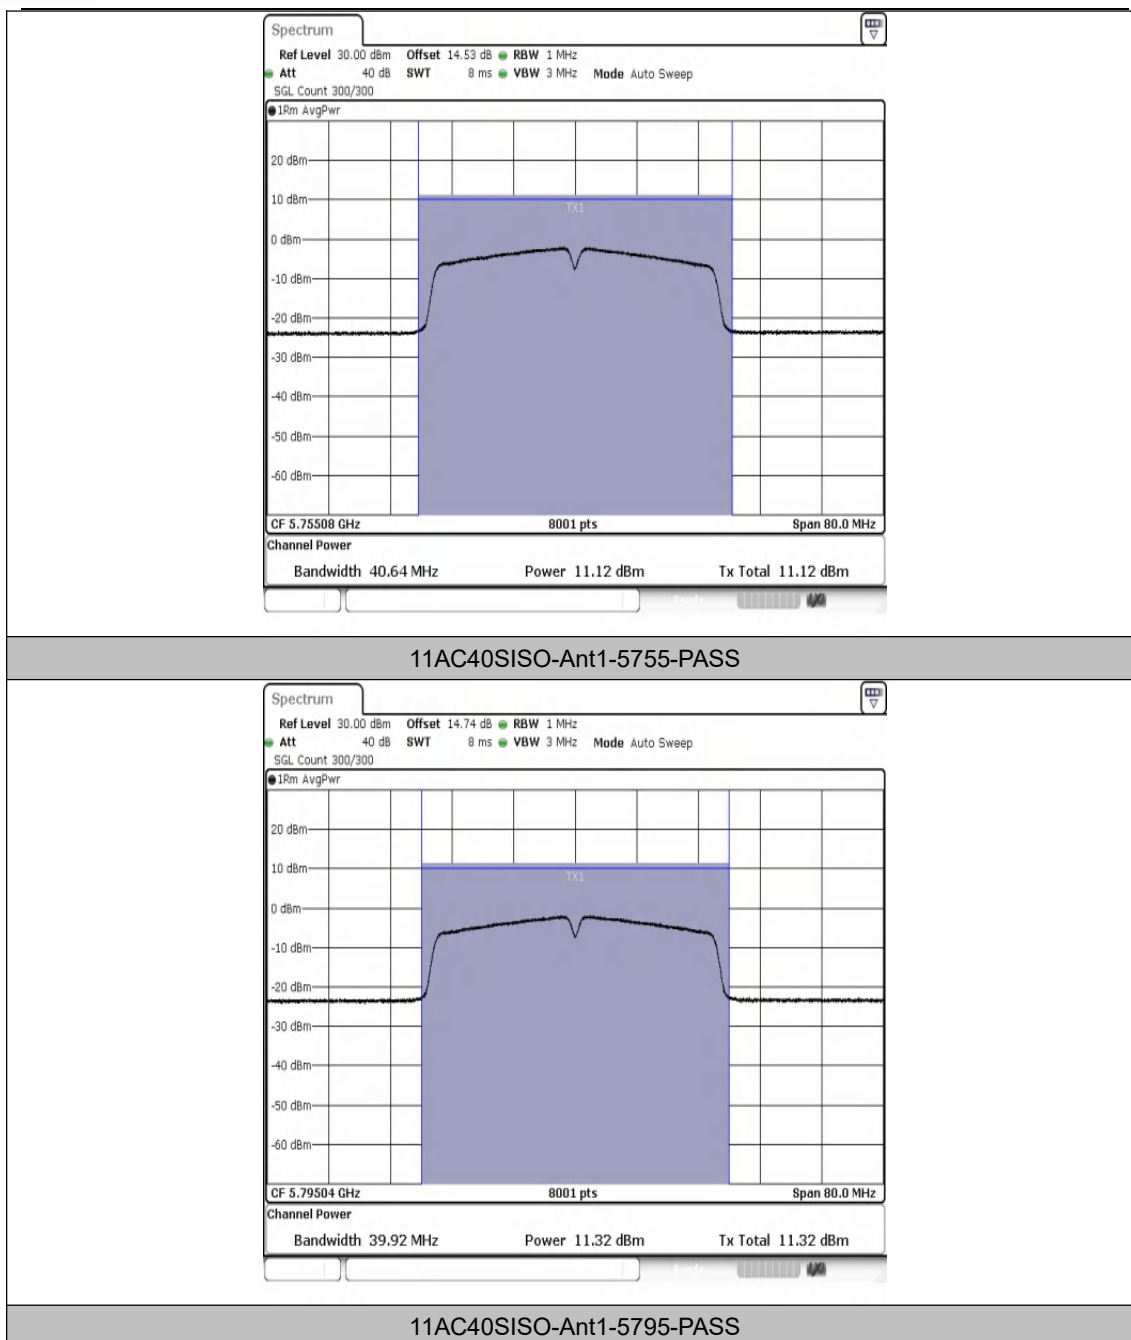

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

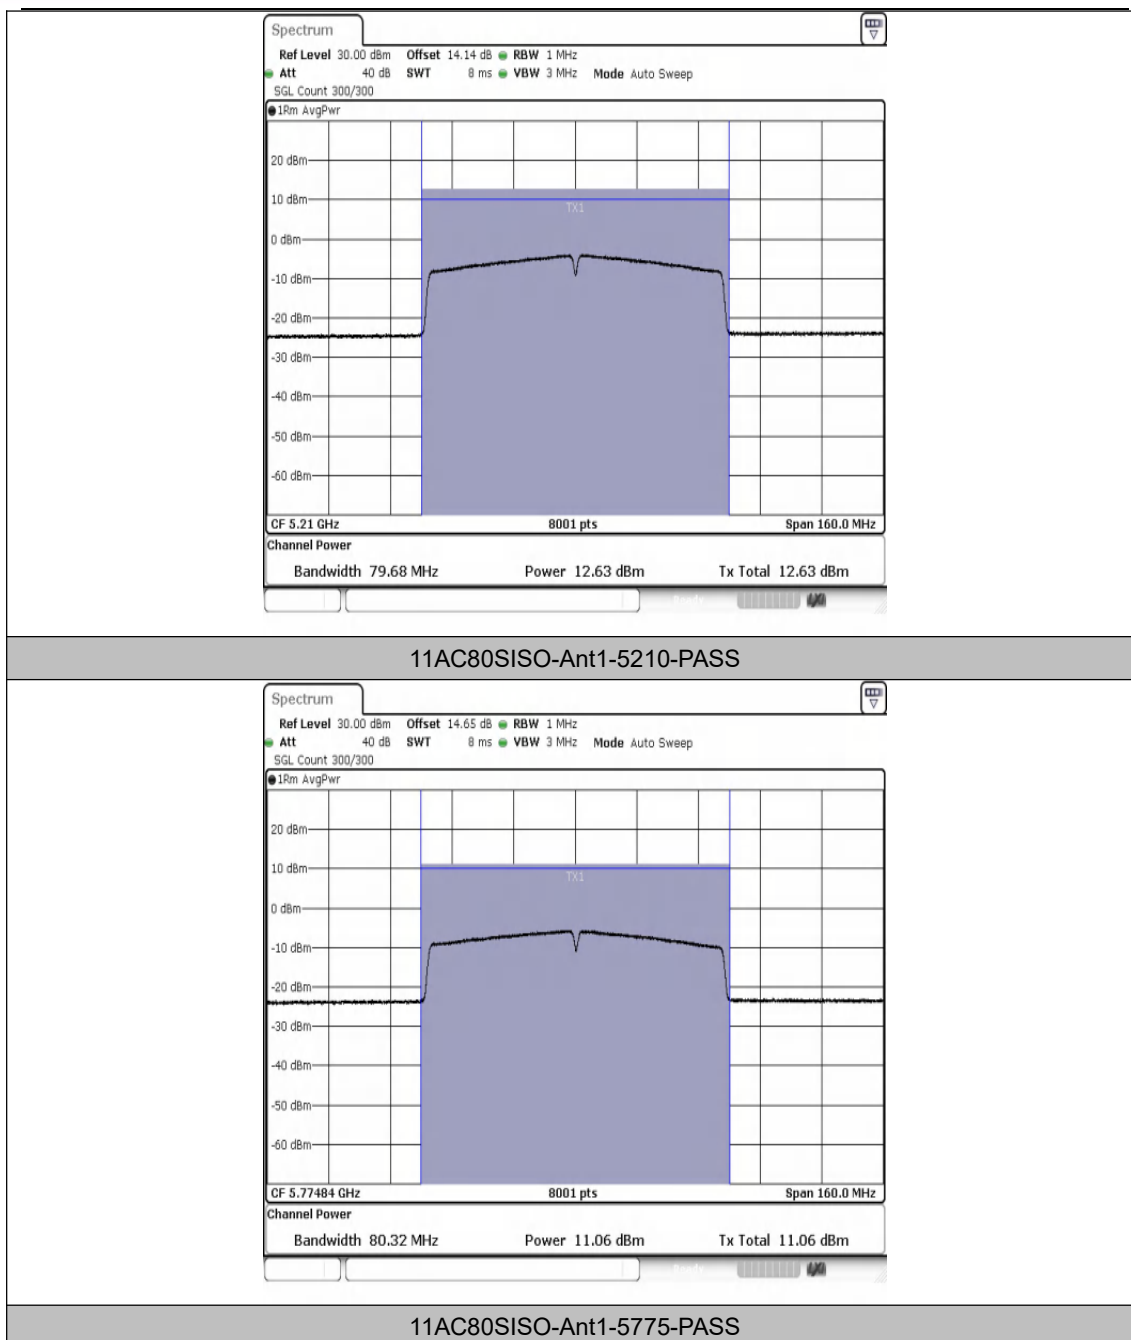

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency [MHz]	Reading Result[dBm/MHz]	DC Factor [dB]	Result [dBm/MHz]	Limit[dBm/MHz]	Verdict
11A	Ant1	5180	0.61	0.00	0.61	≤11.00	PASS
11A	Ant1	5200	1.25	0.00	1.25	≤11.00	PASS
11A	Ant1	5240	1.47	0.00	1.47	≤11.00	PASS
11N20SISO	Ant1	5180	2.23	0.00	2.23	≤11.00	PASS
11N20SISO	Ant1	5200	2.16	0.00	2.16	≤11.00	PASS
11N20SISO	Ant1	5240	2.46	0.00	2.46	≤11.00	PASS
11N40SISO	Ant1	5190	-0.71	0.00	-0.71	≤11.00	PASS
11N40SISO	Ant1	5230	0.08	0.00	0.08	≤11.00	PASS
11AC20SISO	Ant1	5180	2.32	0.00	2.32	≤11.00	PASS
11AC20SISO	Ant1	5200	2.61	0.00	2.61	≤11.00	PASS
11AC20SISO	Ant1	5240	2.64	0.00	2.64	≤11.00	PASS
11AC40SISO	Ant1	5190	-0.09	0.00	-0.09	≤11.00	PASS
11AC40SISO	Ant1	5230	0	0.00	0.00	≤11.00	PASS
11AC80SISO	Ant1	5210	-3.6	0.00	-3.60	≤11.00	PASS


Note: The Duty Cycle Factor and cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency [MHz]	Reading Result [dBm/MHz]	DC Factor [dB]	Result [dBm/500 KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-1.54	0.00	-1.54	≤30.00	PASS
11A	Ant1	5785	-1.69	0.00	-1.69	≤30.00	PASS
11A	Ant1	5825	-1.39	0.00	-1.39	≤30.00	PASS
11N20SISO	Ant1	5745	-2.39	0.00	-2.39	≤30.00	PASS
11N20SISO	Ant1	5785	-2.27	0.00	-2.27	≤30.00	PASS
11N20SISO	Ant1	5825	-2.01	0.00	-2.01	≤30.00	PASS
11N40SISO	Ant1	5755	-4.89	0.00	-4.89	≤30.00	PASS
11N40SISO	Ant1	5795	-4.76	0.00	-4.76	≤30.00	PASS
11AC20SISO	Ant1	5745	-2.35	0.00	-2.35	≤30.00	PASS
11AC20SISO	Ant1	5785	-2.04	0.00	-2.04	≤30.00	PASS
11AC20SISO	Ant1	5825	-1.83	0.00	-1.83	≤30.00	PASS
11AC40SISO	Ant1	5755	-4.86	0.00	-4.86	≤30.00	PASS
11AC40SISO	Ant1	5795	-5.09	0.00	-5.09	≤30.00	PASS
11AC80SISO	Ant1	5775	-8.82	0.00	-8.82	≤30.00	PASS

Note: The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs

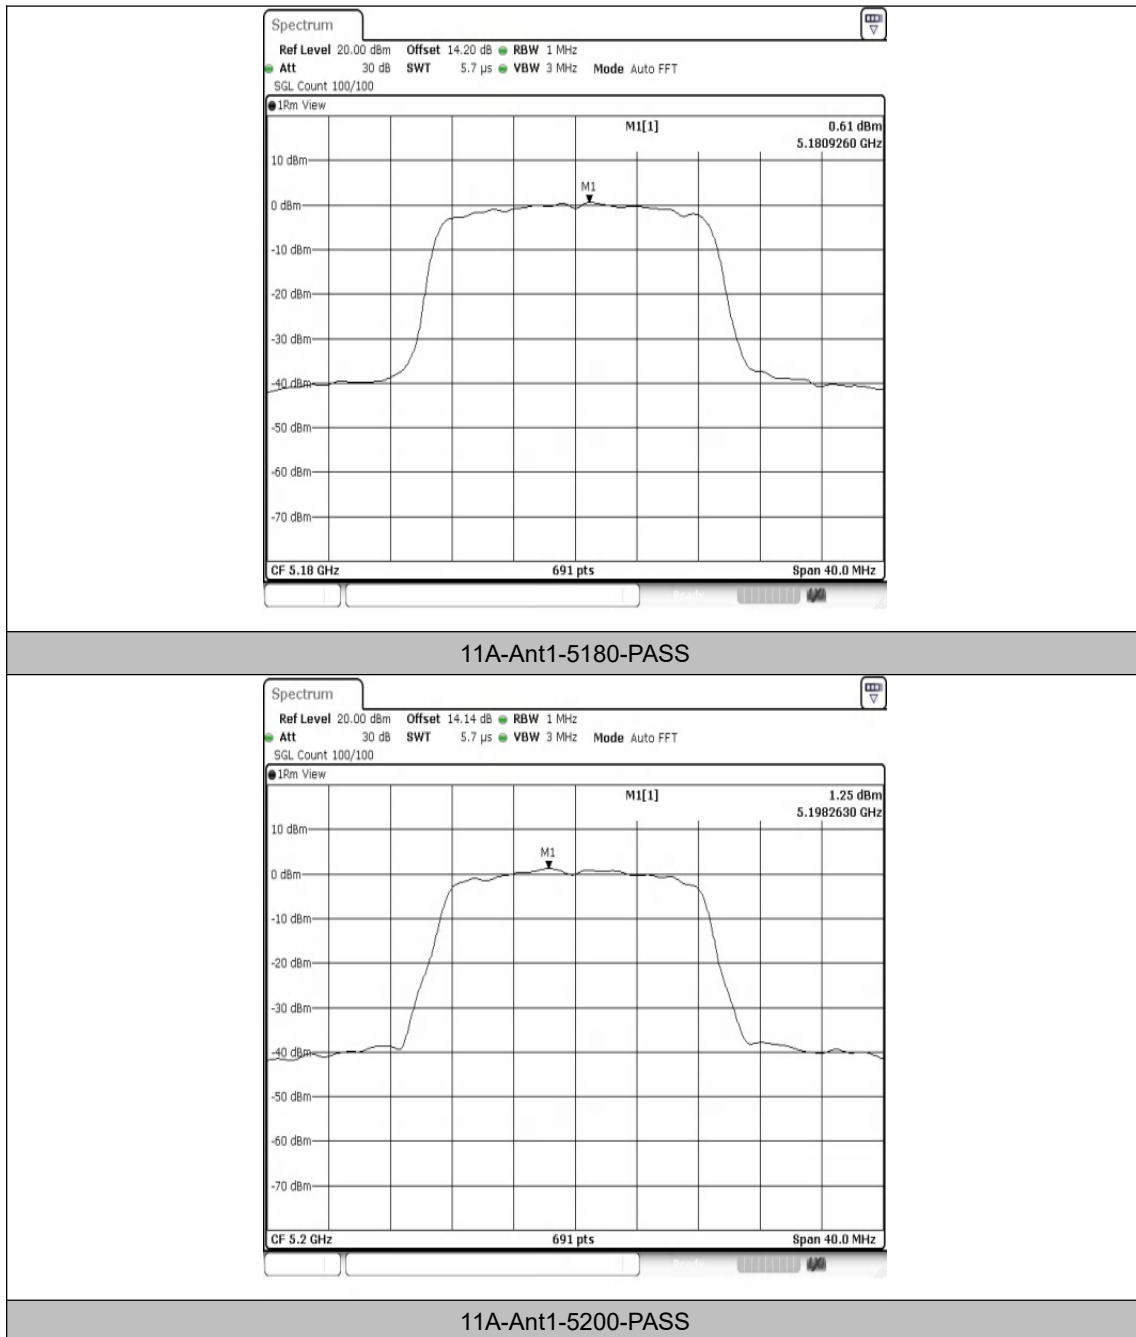

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

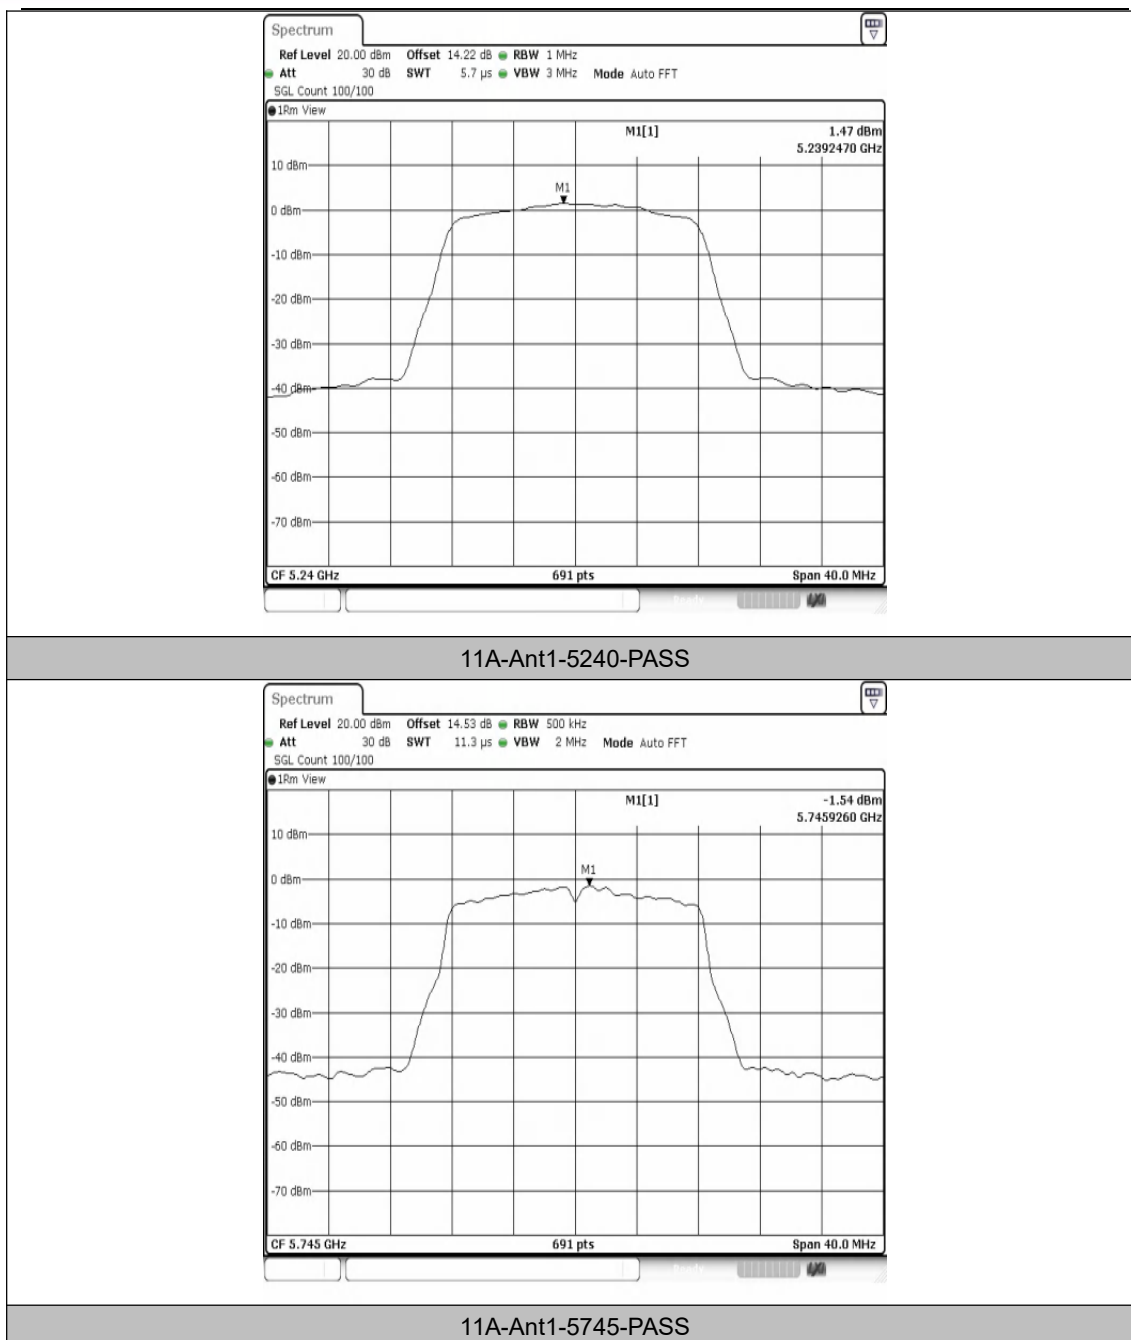

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

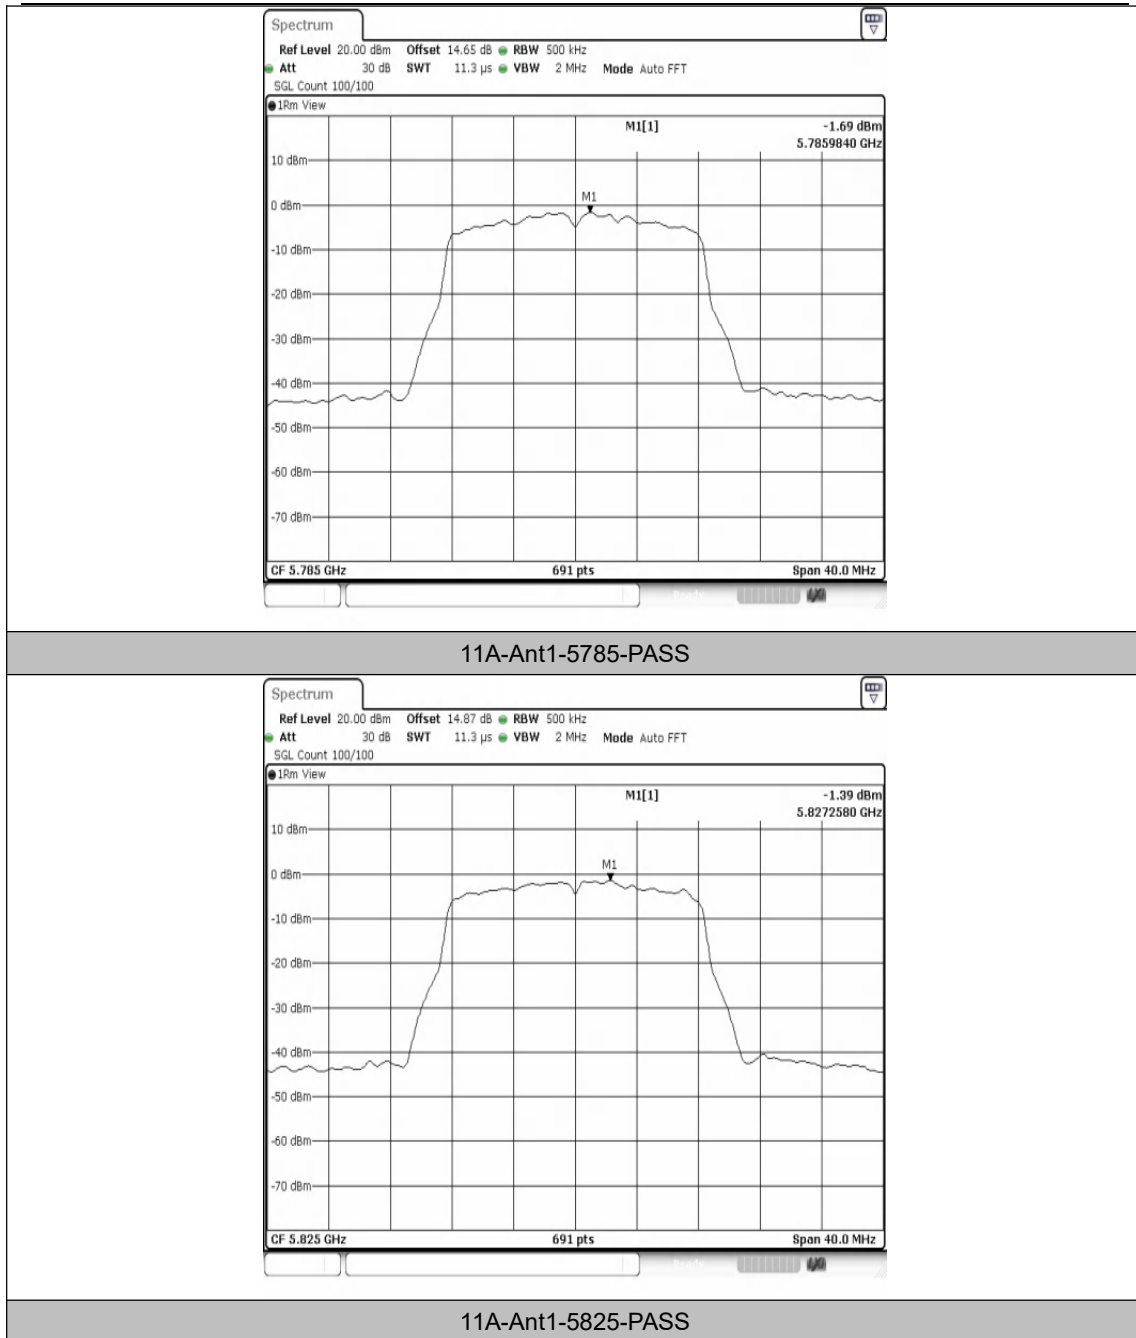

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

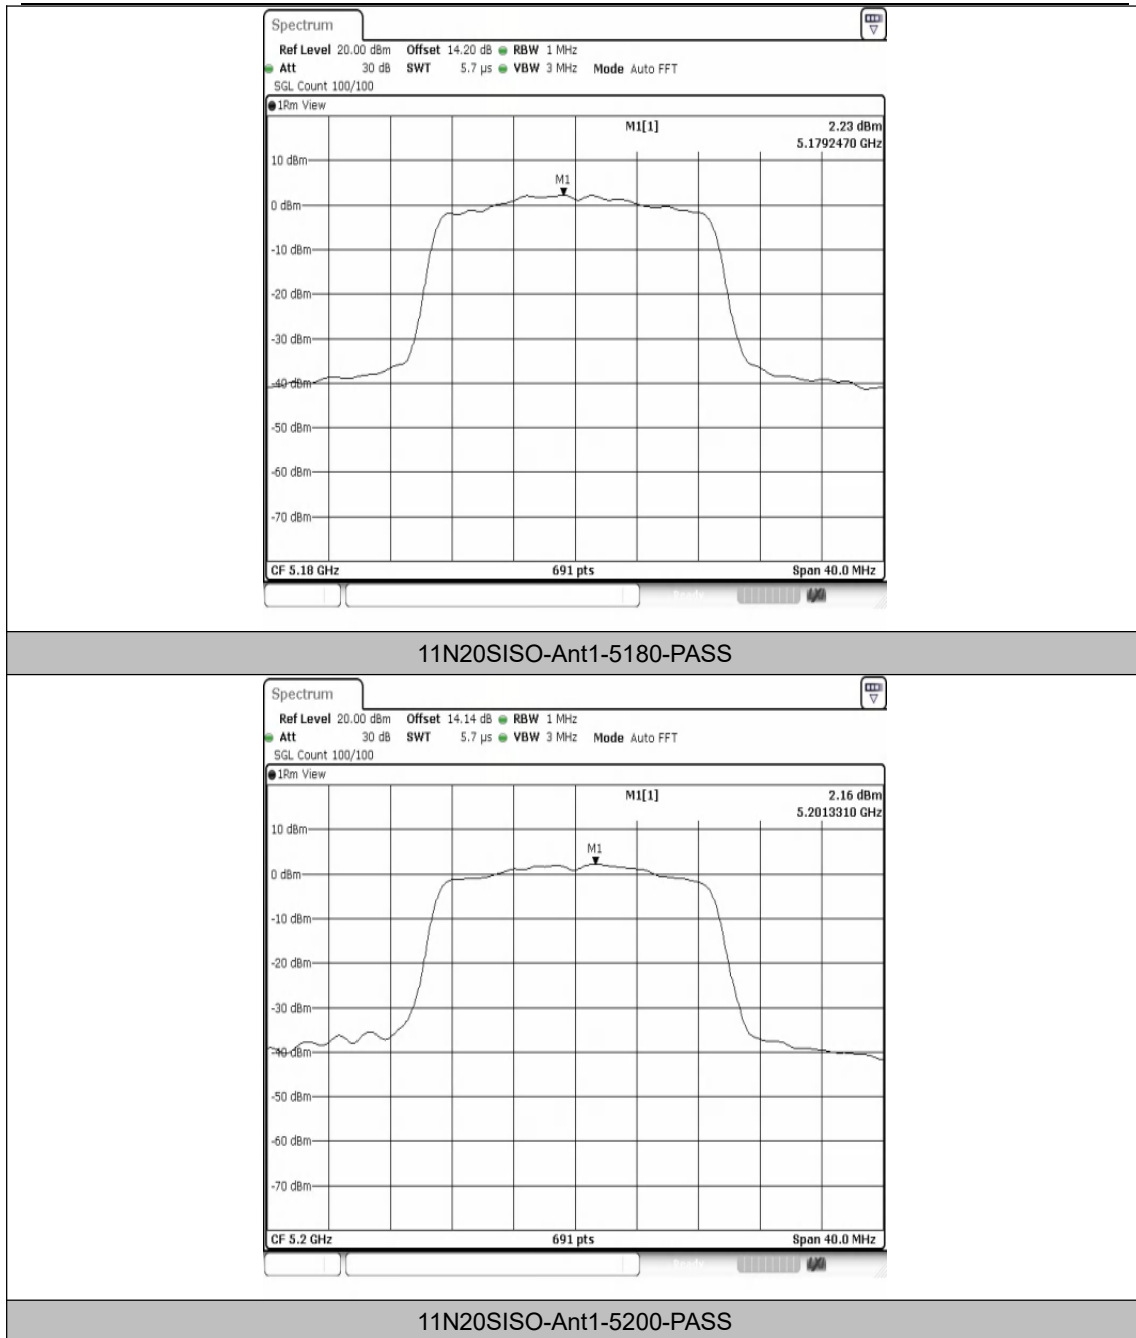



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

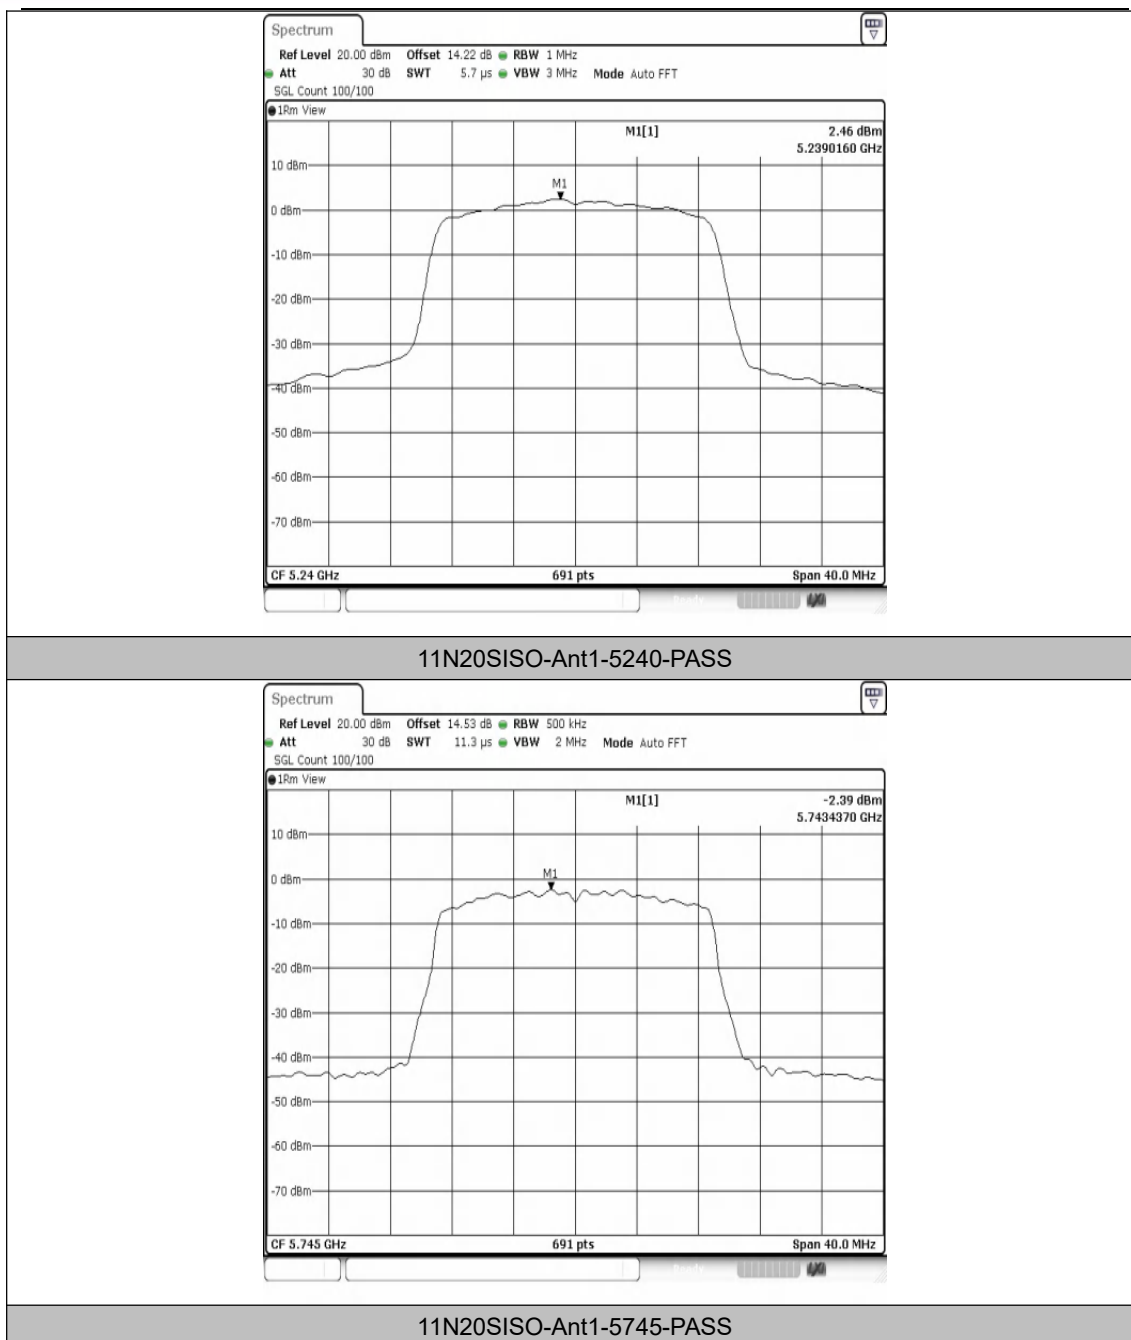

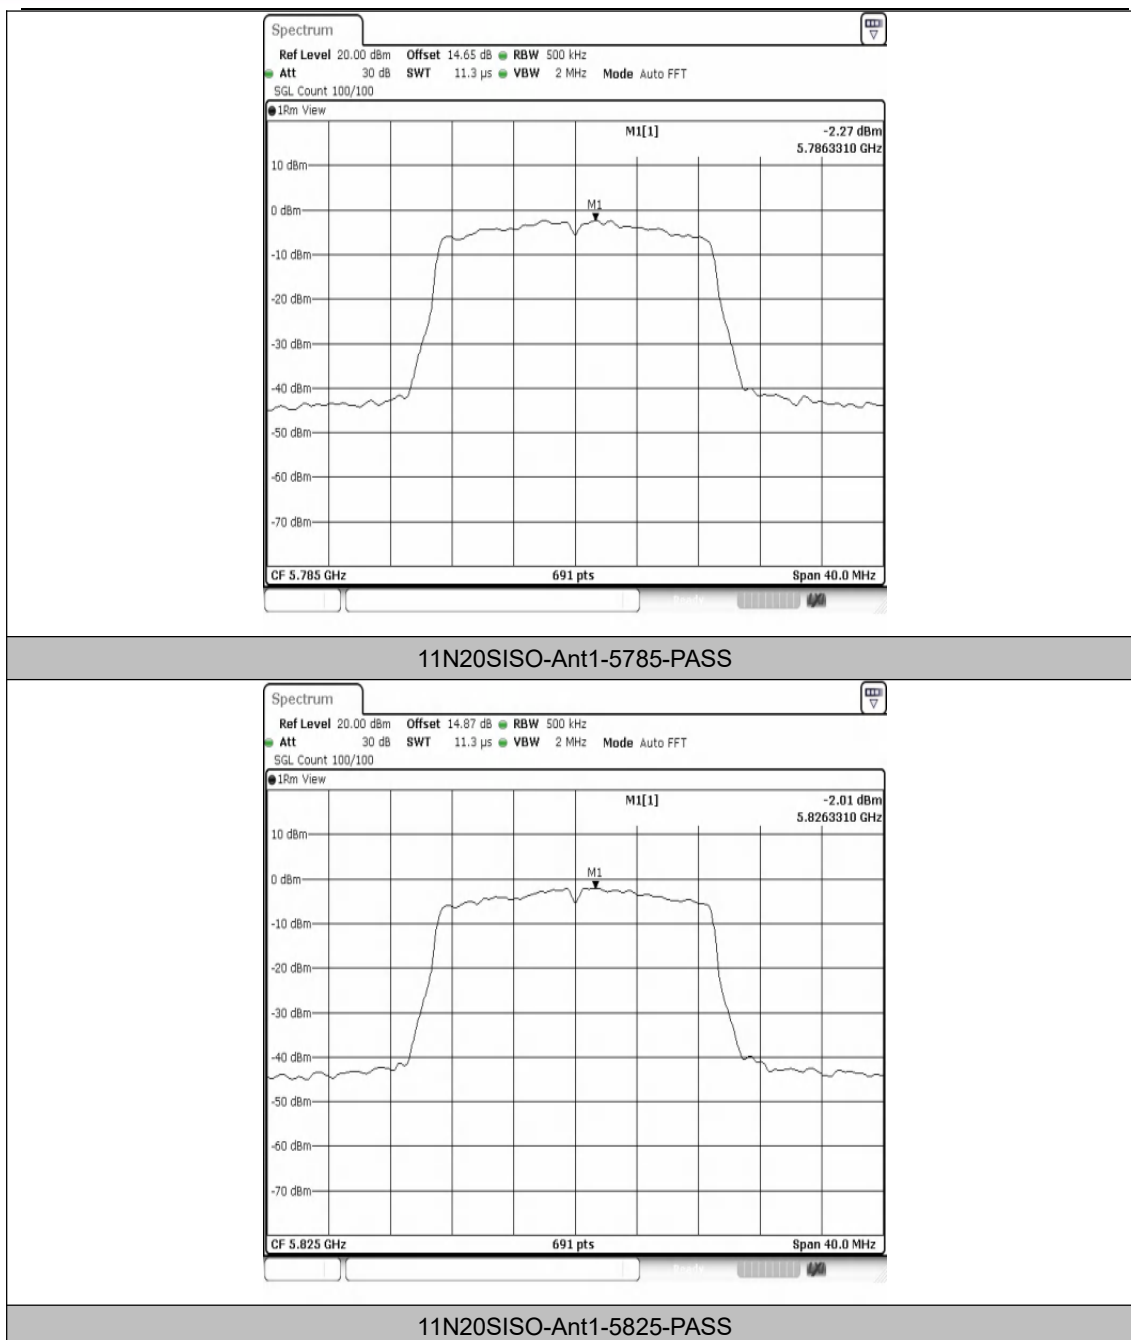


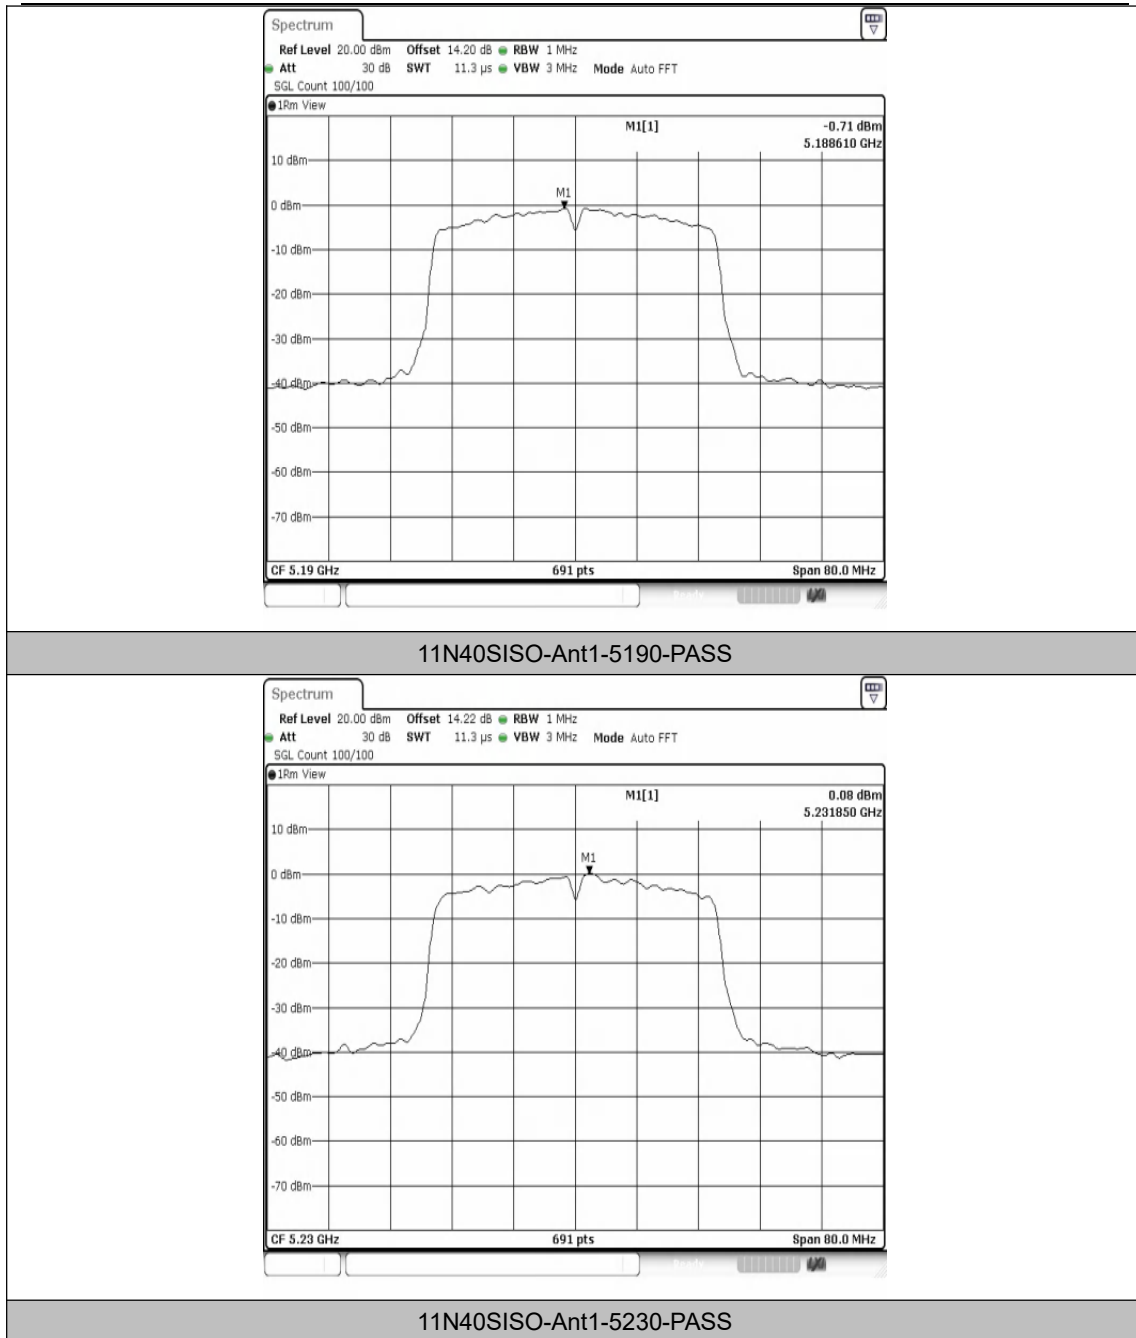


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

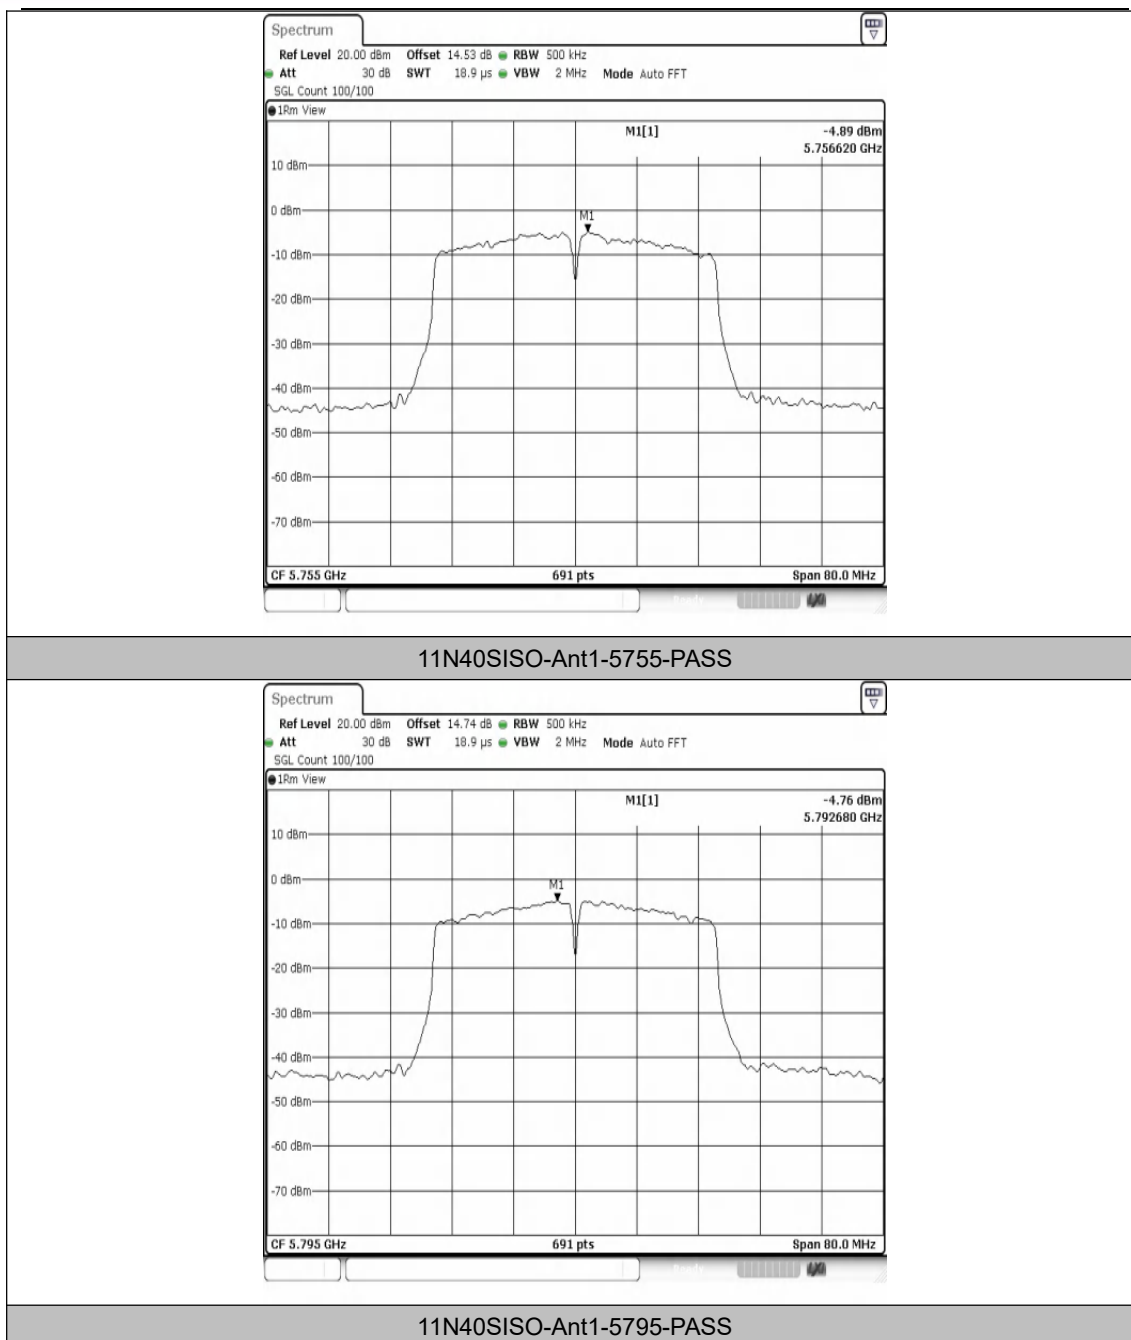


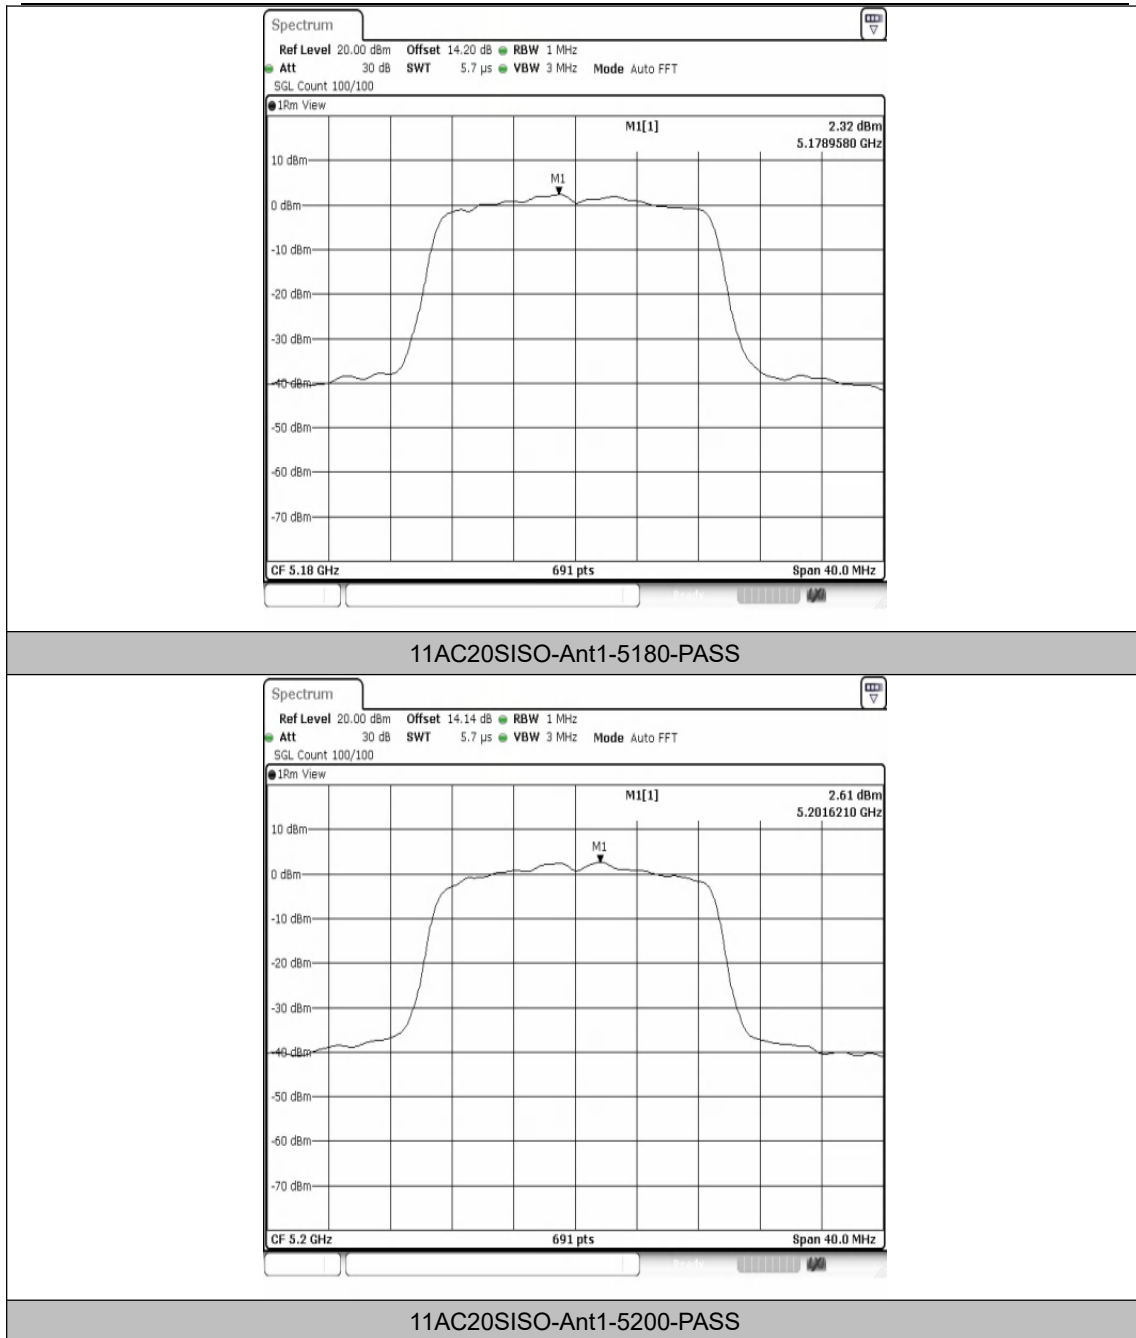


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

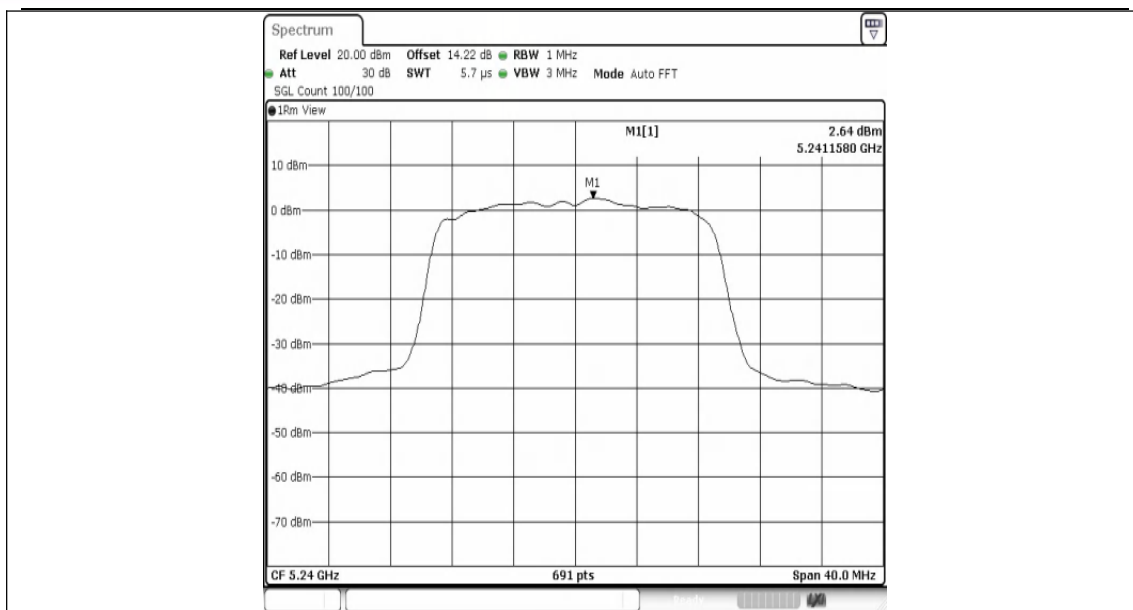

11AC20SISO-Ant1-5240-PASS

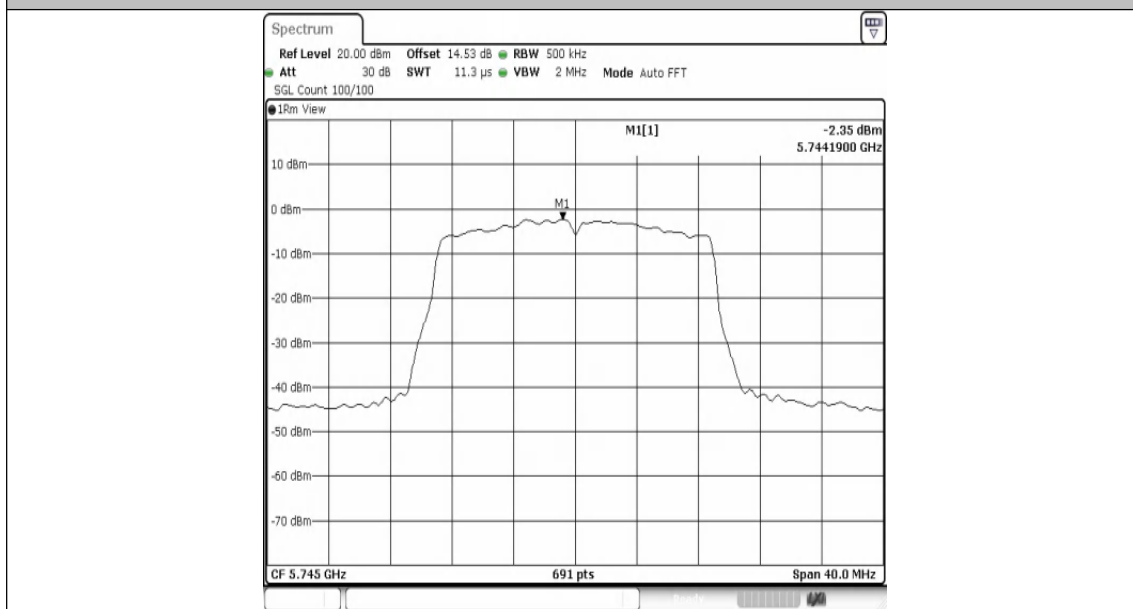


11AC20SISO-Ant1-5745-PASS

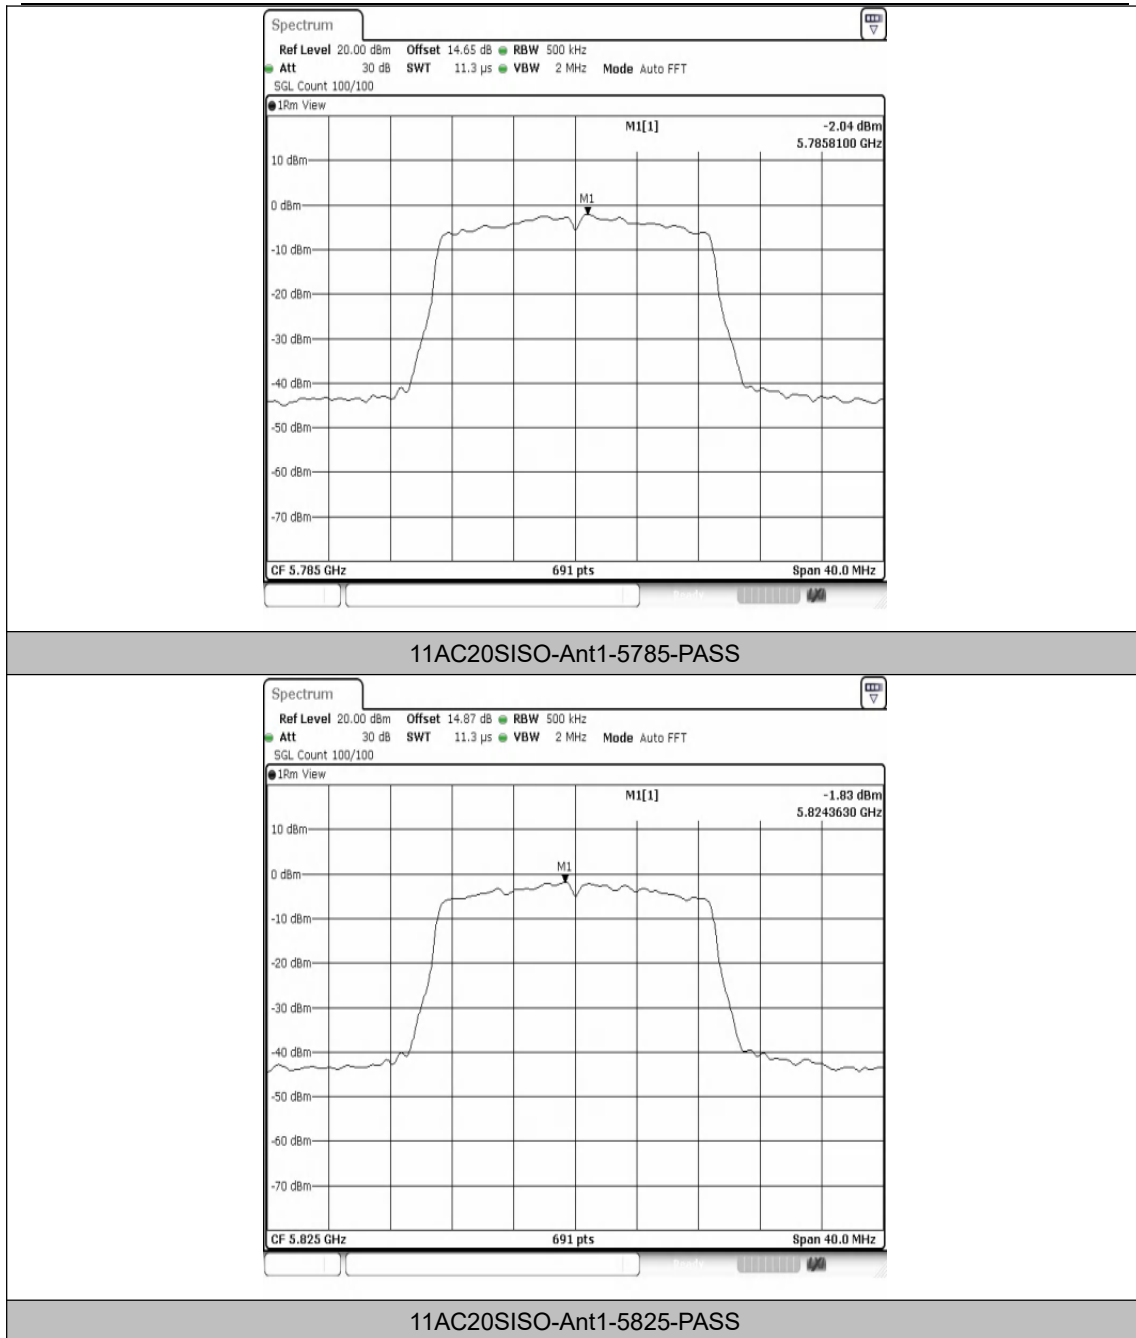

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
 Tel:(86)0755-26066440 Email:service@anbotek.com


Hotline
 400-003-0500
www.anbotek.com

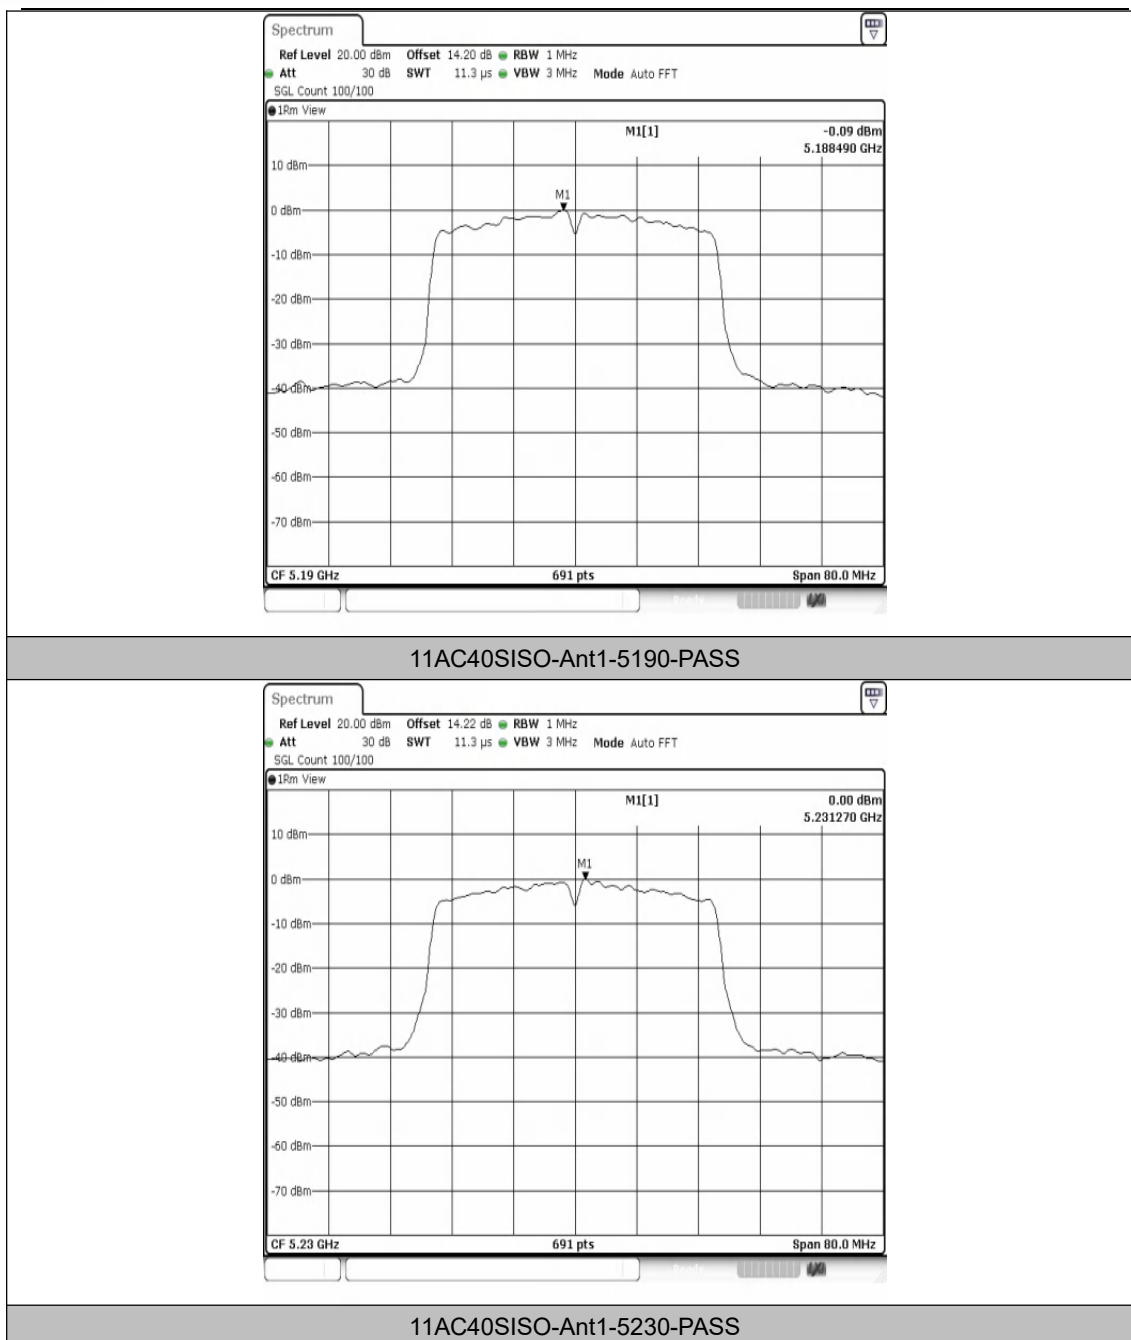

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

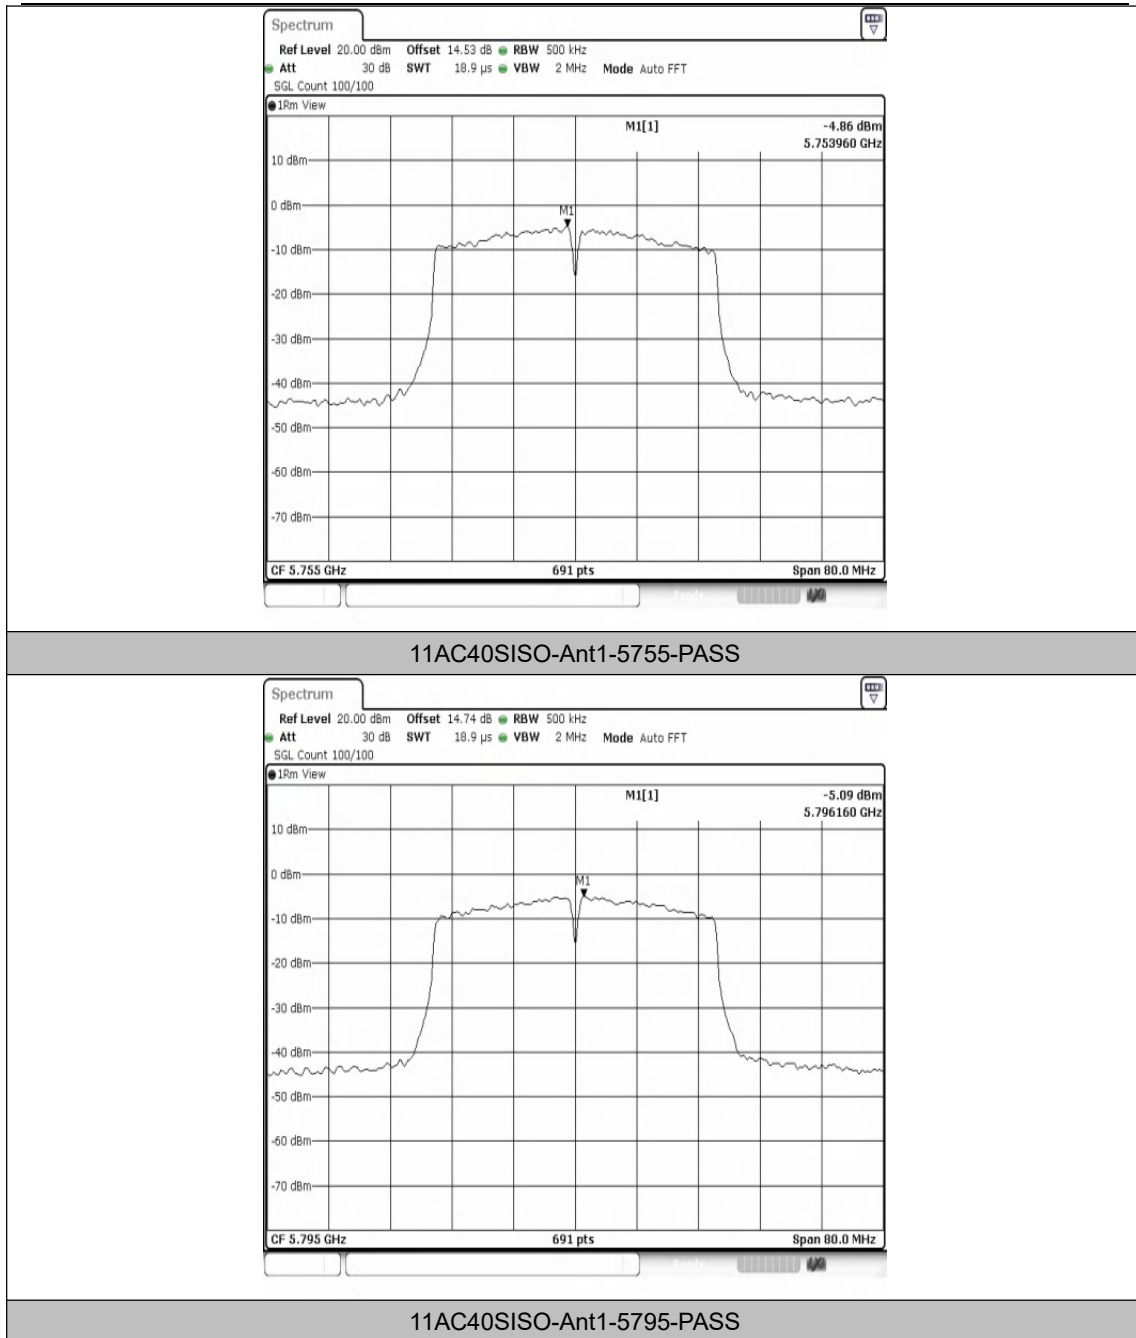


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

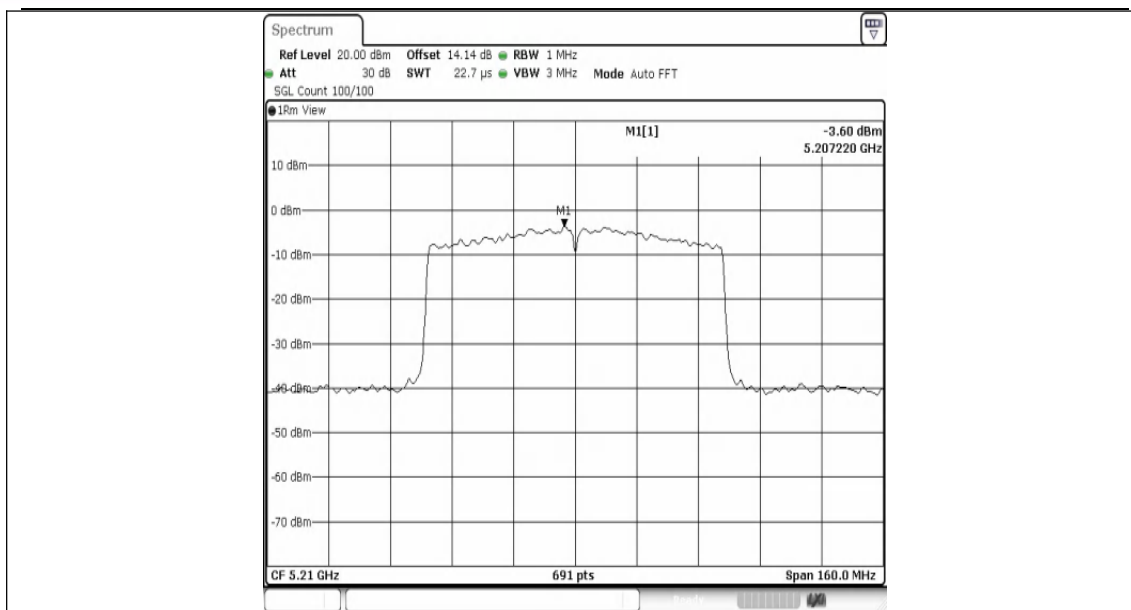

11AC80SISO-Ant1-5210-PASS

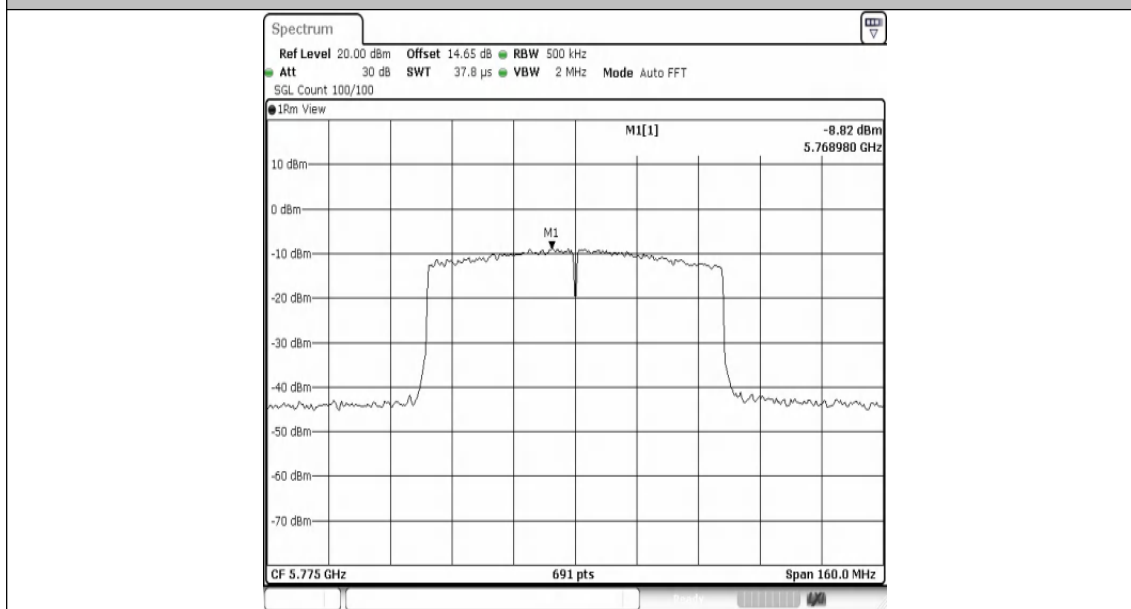

11AC80SISO-Ant1-5775-PASS

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-36.57	≤-27	PASS
11A	Ant1	High	5240	-45.23	≤-27	PASS
11N20SISO	Ant1	Low	5180	-35.44	≤-27	PASS
11N20SISO	Ant1	High	5240	-45.39	≤-27	PASS
11N40SISO	Ant1	Low	5190	-31.39	≤-27	PASS
11N40SISO	Ant1	High	5230	-44.33	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-36.6	≤-27	PASS
11AC20SISO	Ant1	High	5240	-44.34	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-35.88	≤-27	PASS
11AC40SISO	Ant1	High	5230	-44.99	≤-27	PASS
11AC80SISO	Ant1	High	5210	-44.52	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-33.63	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-35.85	≤15.98	PASS
11A	Ant1	Low	5745	5700~5720	-35.85	≤15.51	PASS
11A	Ant1	Low	5745	5650~5700	-46.19	≤-26.88	PASS
11A	Ant1	Low	5745	5760~5650	-45.17	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-37.33	≤16.10	PASS
11A	Ant1	High	5825	5855~5875	-38.67	≤15.55	PASS
11A	Ant1	High	5825	5875~5925	-44.7	≤-26.15	PASS
11A	Ant1	High	5825	5925~5935	-45.45	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-37.73	≤15.98	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-36.98	≤15.32	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-45.86	≤-26.88	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-45.84	≤-27	PASS
11N20SI SO	Ant1	High	5825	5850~5855	-38.34	≤16.10	PASS
11N20SI SO	Ant1	High	5825	5855~5875	-41.78	≤12.32	PASS

Shenzhen Anbotech Compliance Laboratory Limited

11N20SI SO	Ant1	High	5825	5875~5925	-45.34	≤-26.15	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-44.88	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-33.62	≤15.90	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-33.76	≤15.58	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-46.69	≤-26.94	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-45.51	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-41.35	≤18.03	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-45.11	≤10.21	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-46.84	≤-26.97	PASS
11N40SI SO	Ant1	High	5795	5925~5935	-45.49	≤-27	PASS
11AC20S ISO	Ant1	Low	5745	5720~5725	-26.34	≤23.20	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-35.22	≤15.60	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-46.1	≤-26.51	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-45.7	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-42	≤16.10	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-39.87	≤15.00	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-45	≤-26.58	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-45.57	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-39.19	≤15.90	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-40.12	≤11.69	PASS
11AC40S ISO	Ant1	Low	5755	5650~5700	-45.71	≤-26.36	PASS
11AC40S	Ant1	Low	5755	5780~5650	-46.61	≤-27	PASS


Shenzhen Anbotech Compliance Laboratory Limited


ISO							
11AC40S ISO	Ant1	High	5795	5850~5855	-41.31	≤16.39	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-44.03	≤11.08	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-46.6	≤-26.79	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-45.02	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-33.55	≤15.67	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-32.33	≤13.53	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-38.69	≤-20.89	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-41.05	≤-27	PASS
11AC80S ISO	Ant1	High	5775	5850~5855	-37.45	≤15.98	PASS
11AC80S ISO	Ant1	High	5775	5855~5875	-37.49	≤12.57	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-45.45	≤-26.86	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-44.72	≤-27	PASS


Note: The margin plus the antenna gain also meets the limit.





Test Graphs B1

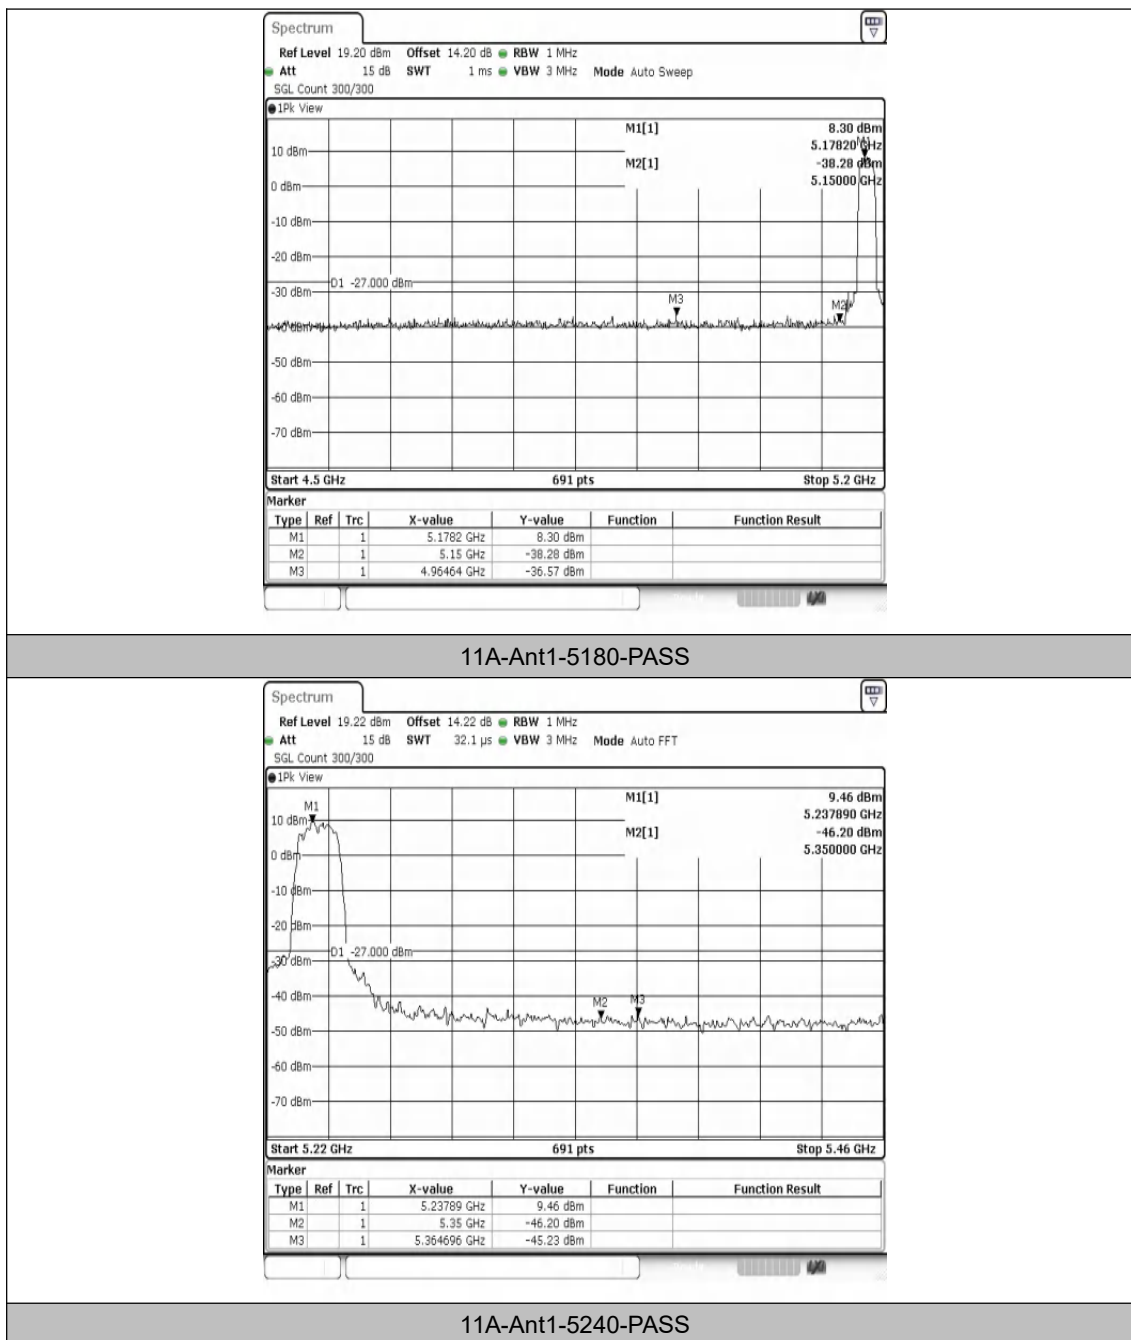


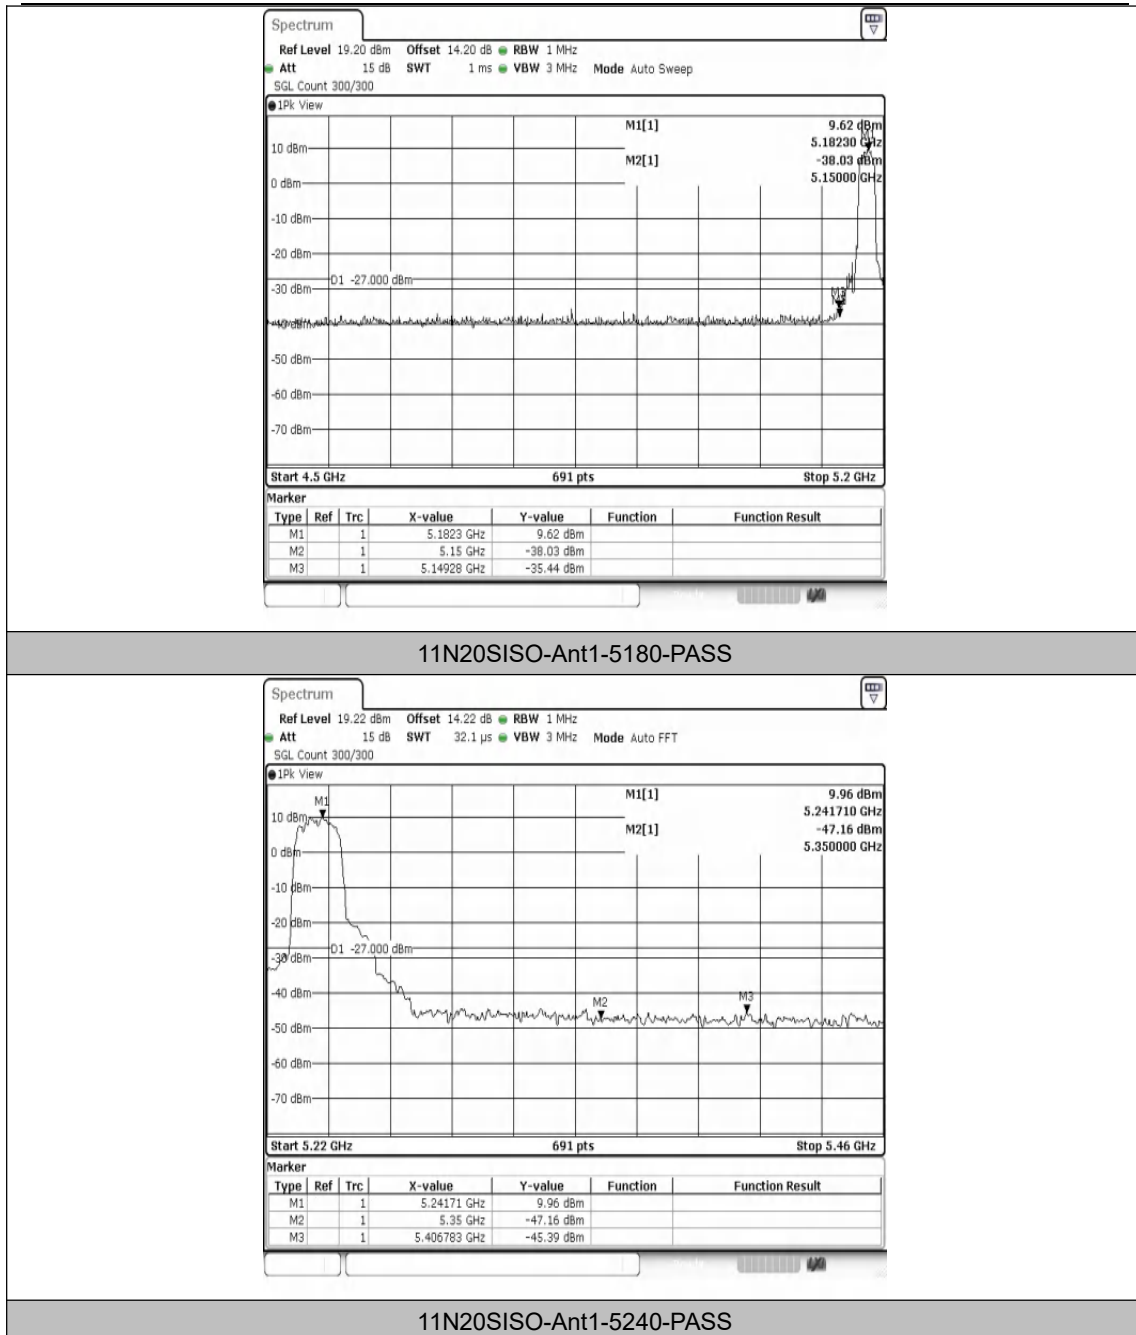

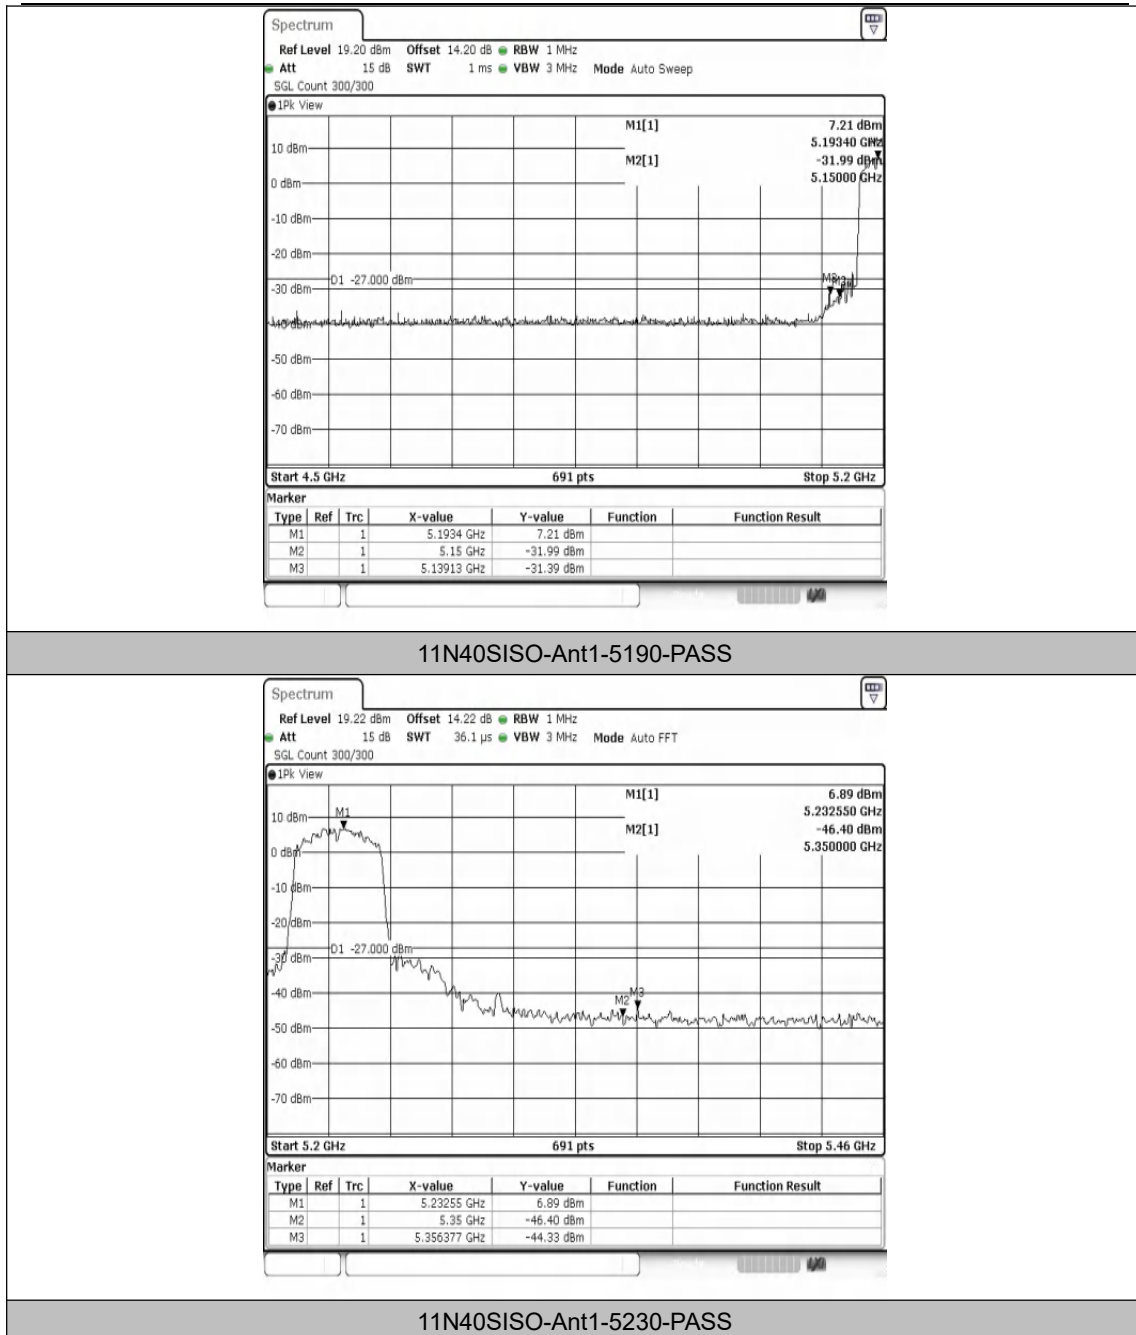


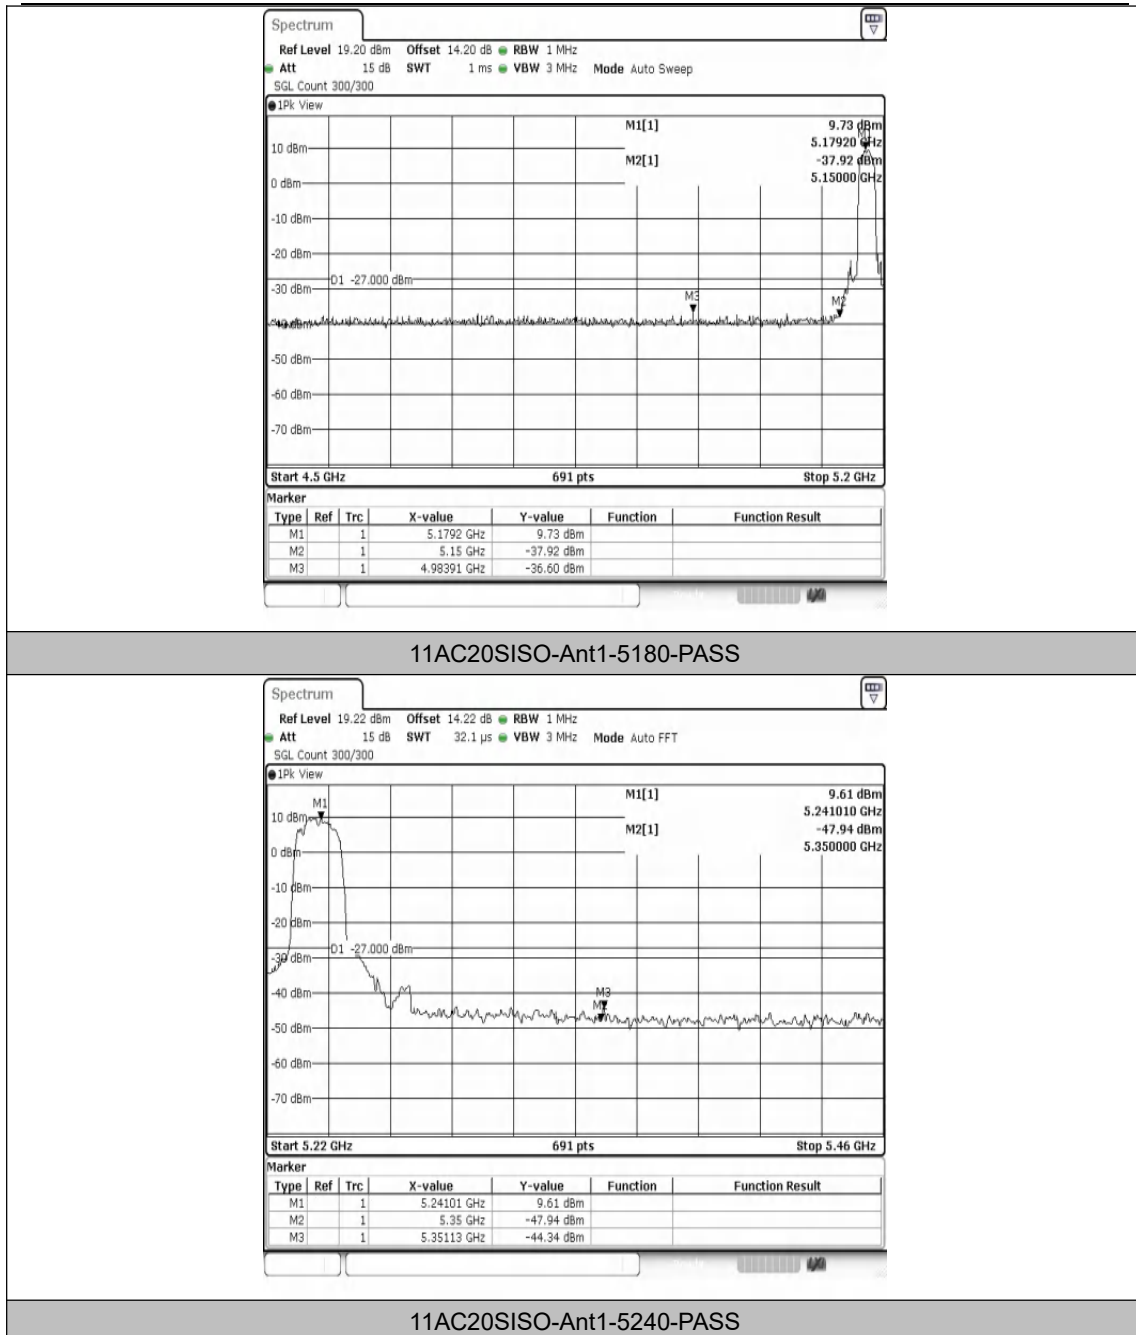


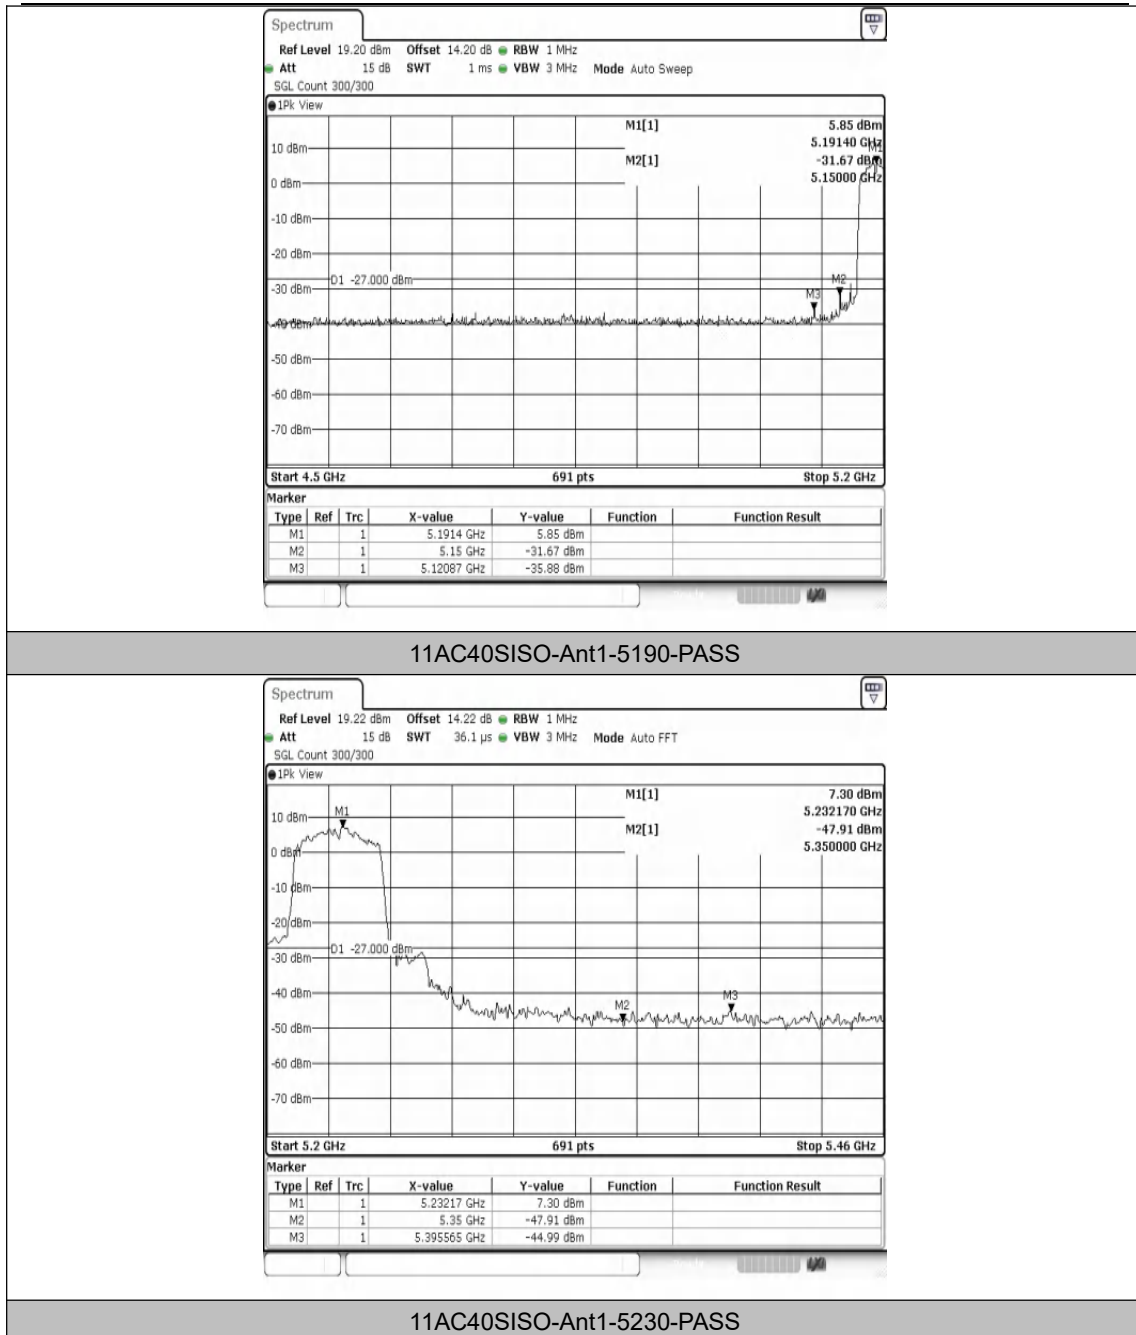


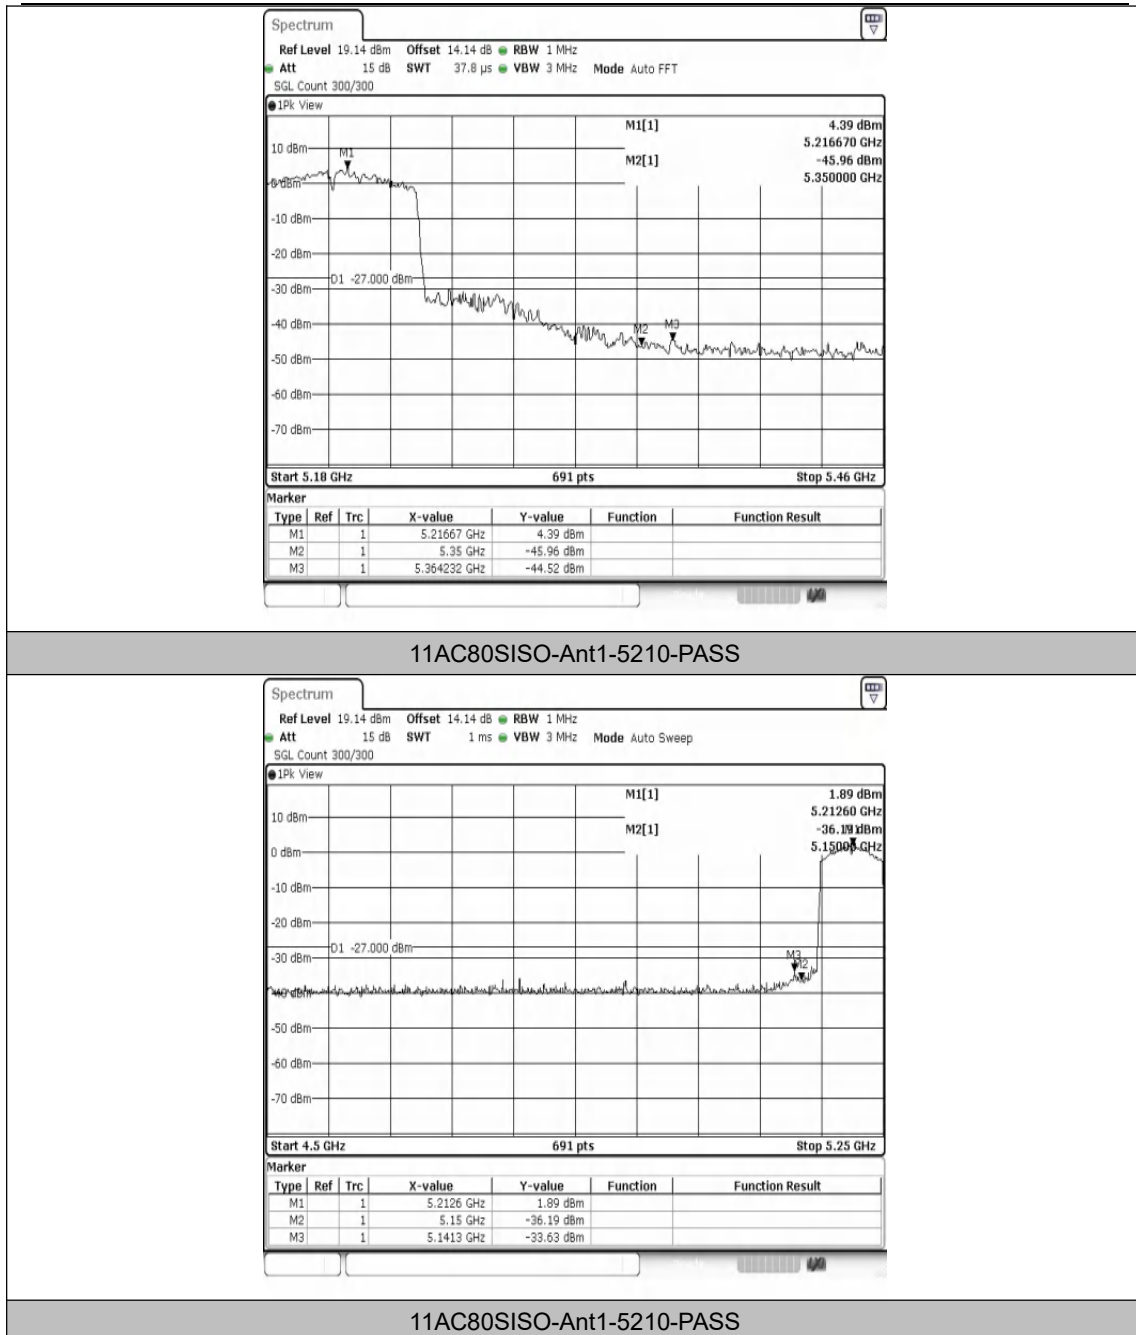


Test Graphs B4

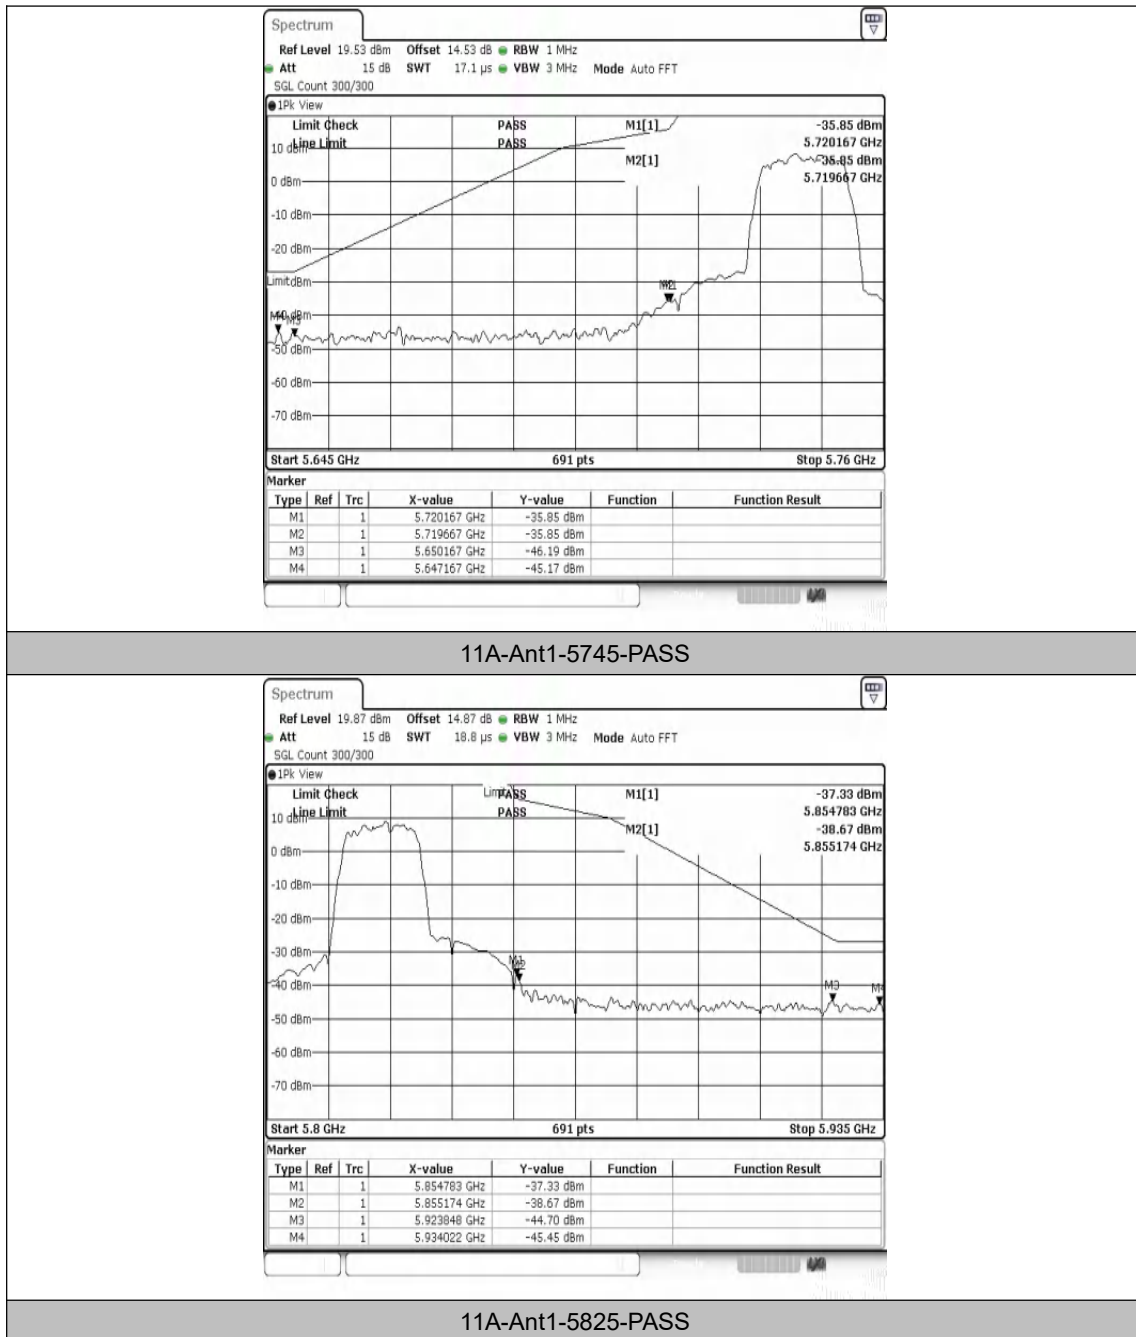


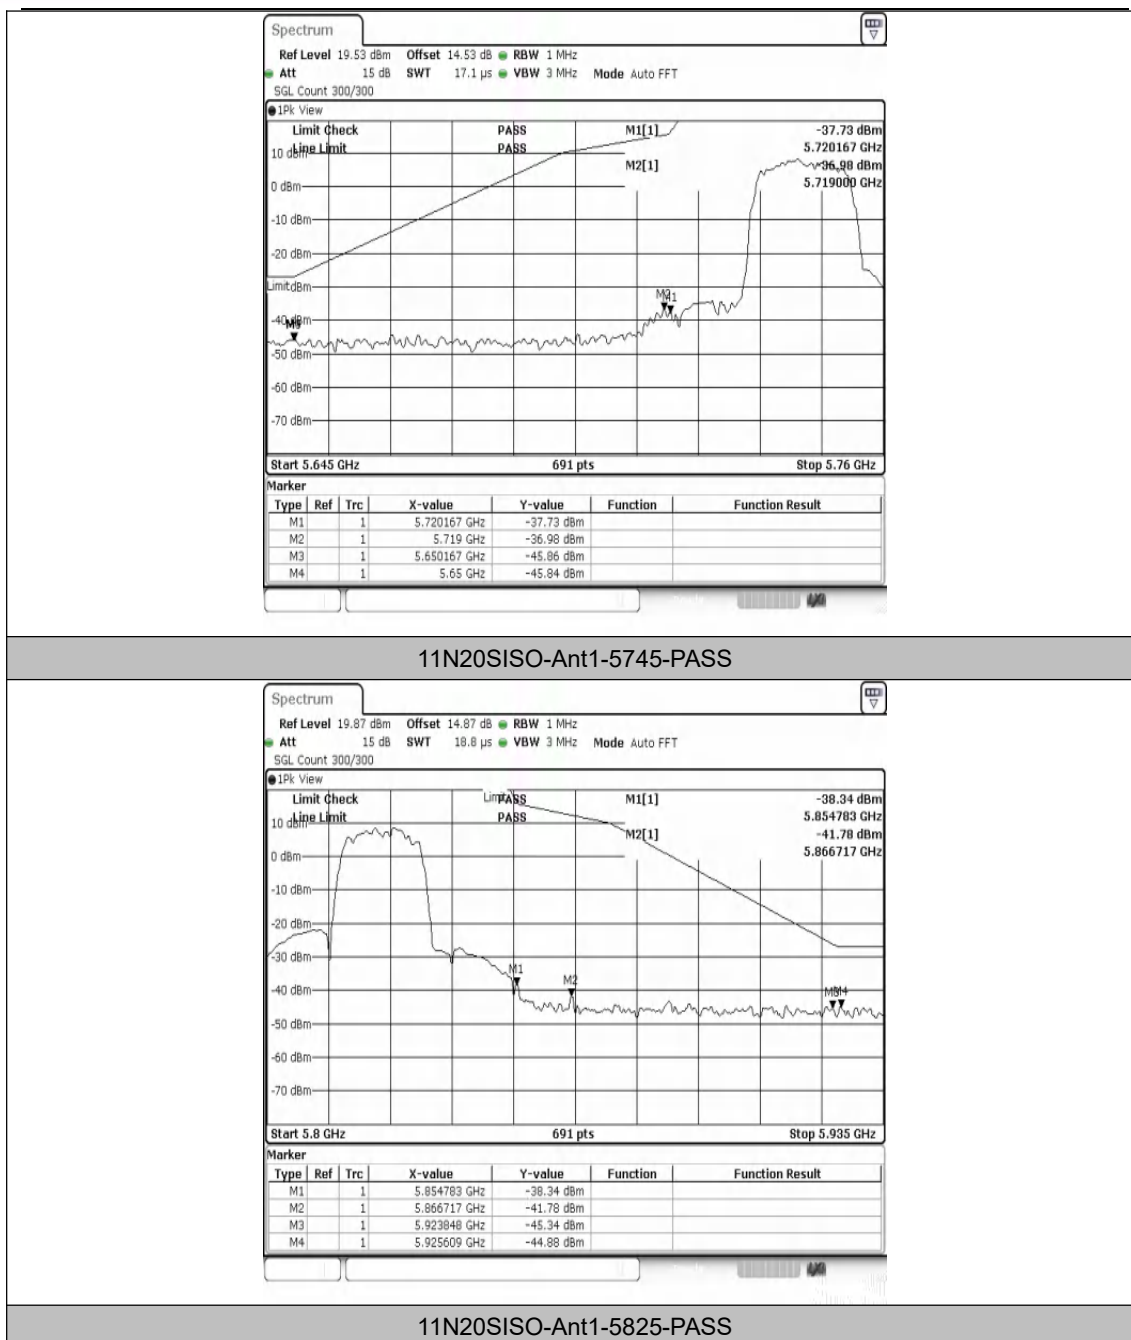

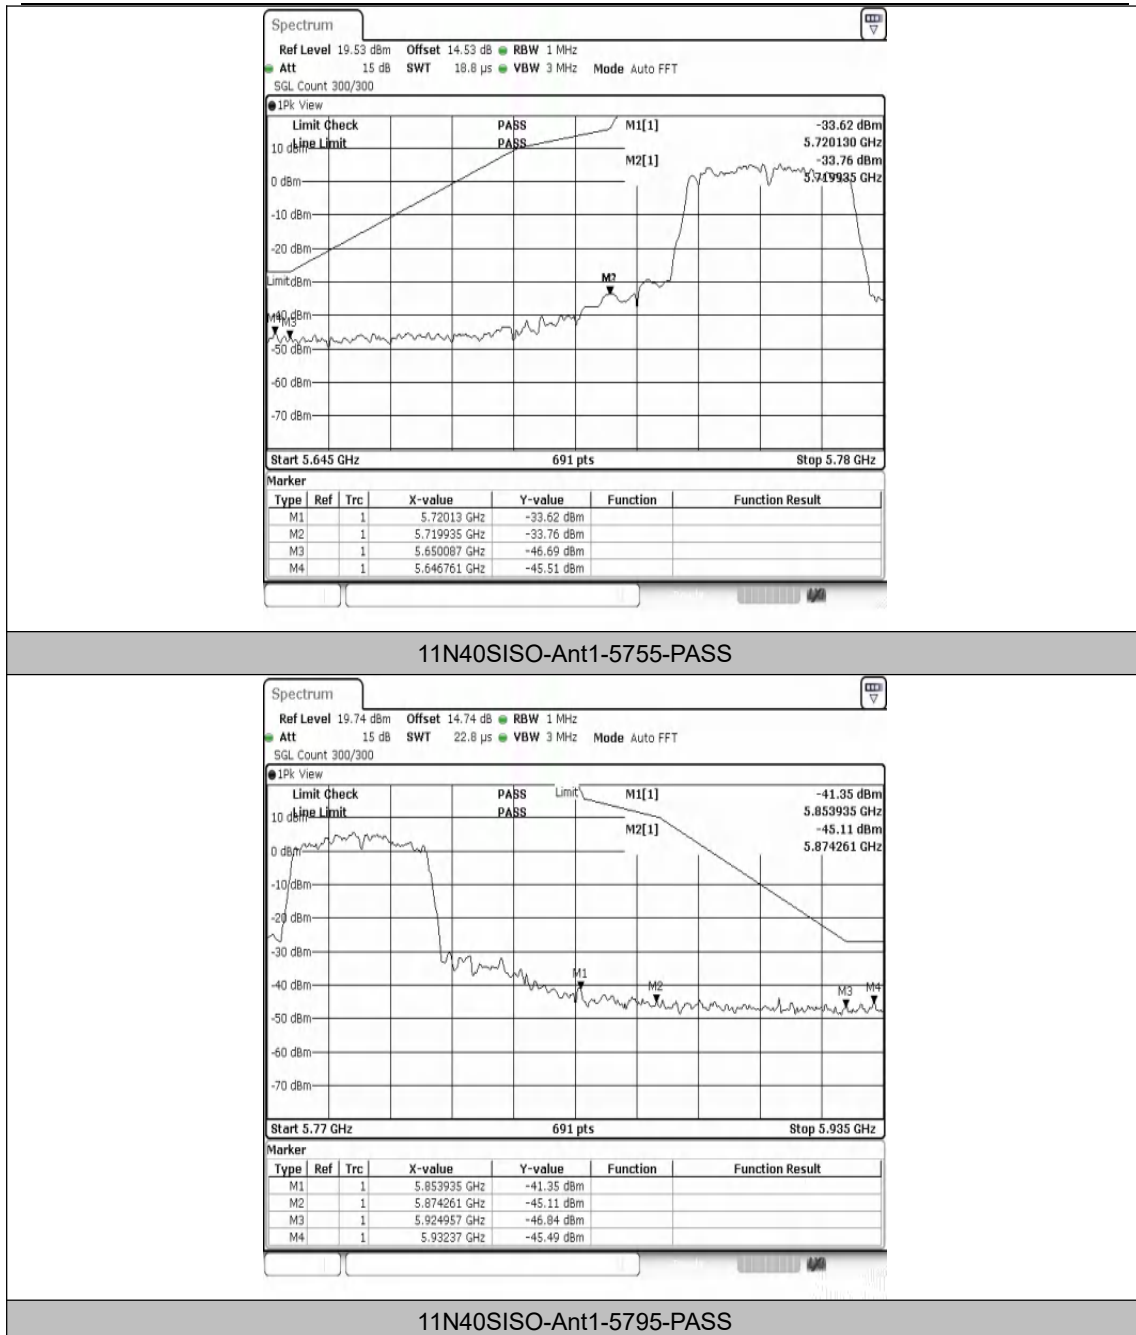


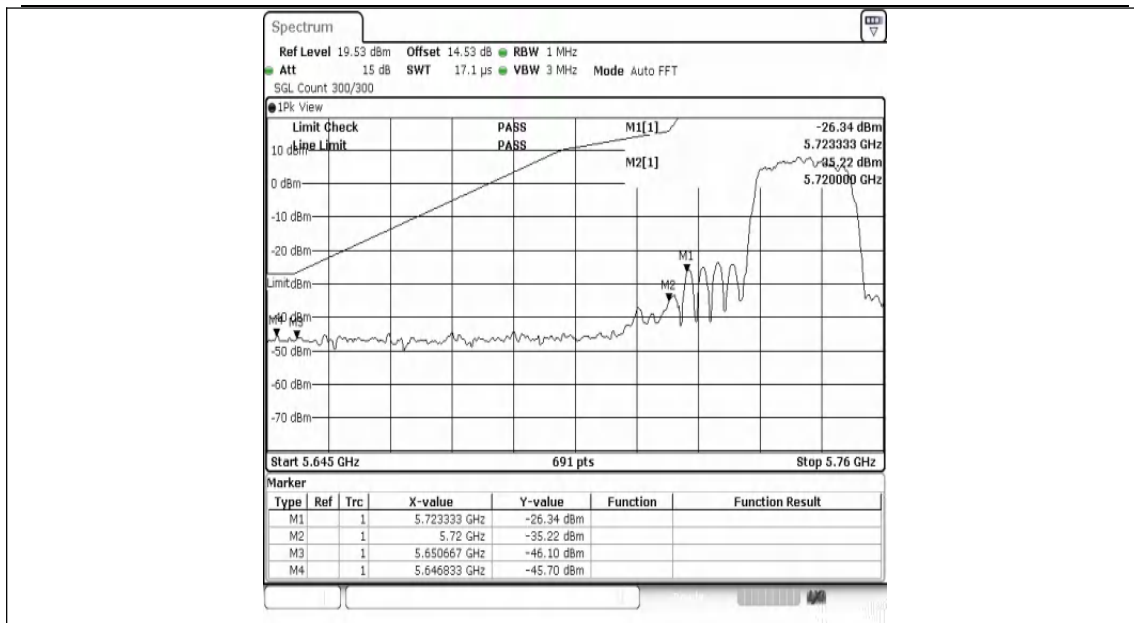


11AC20SISO-Ant1-5745-PASS

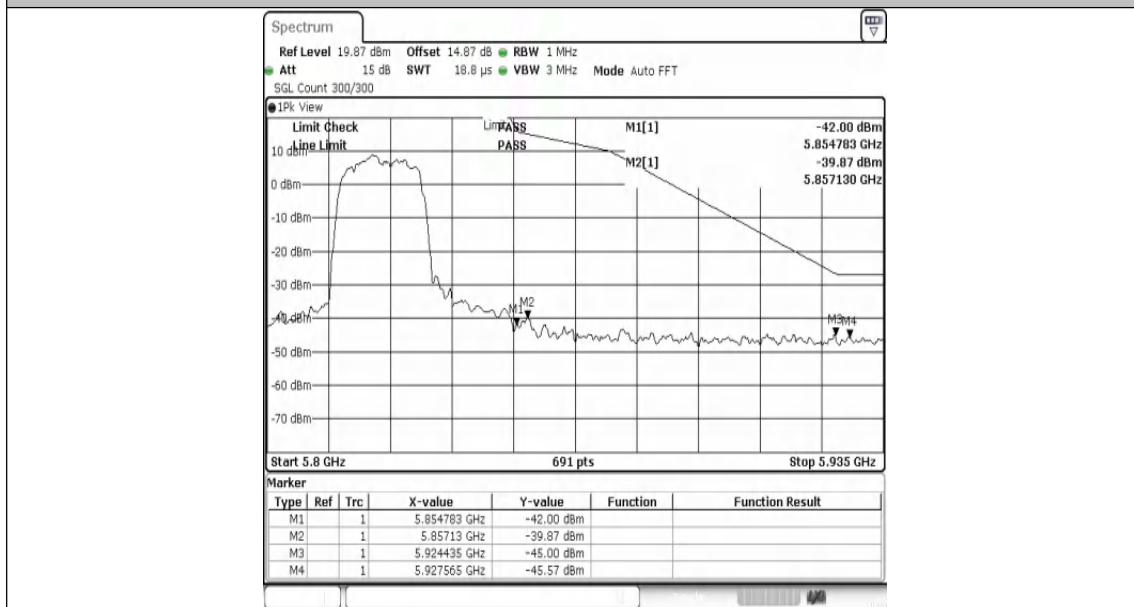


11AC20SISO-Ant1-5825-PASS

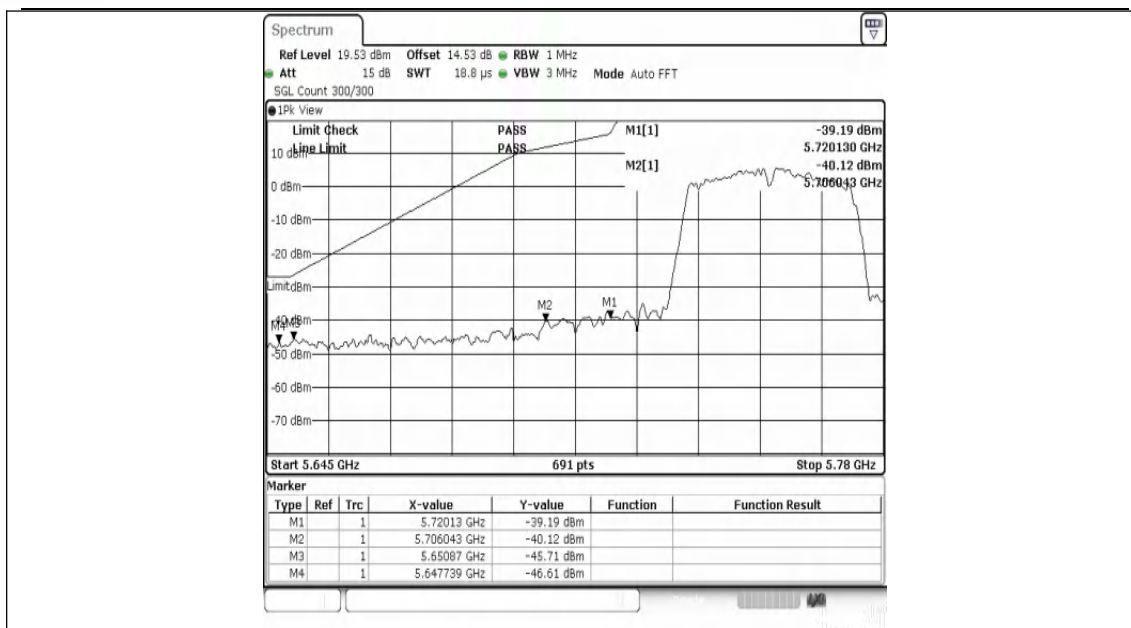

11AC40SISO-Ant1-5755-PASS

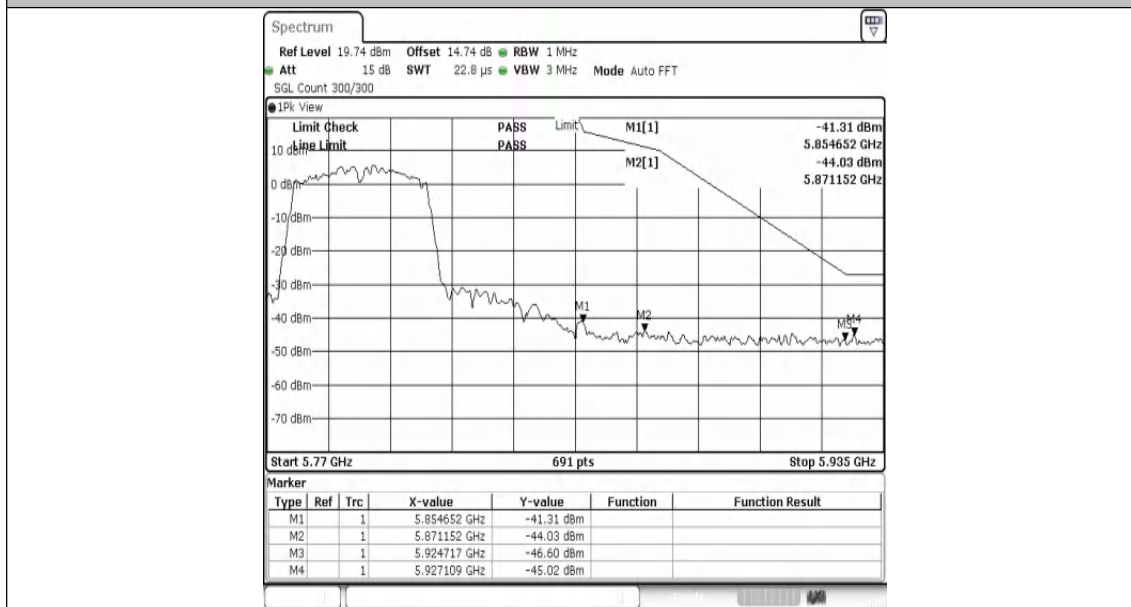

11AC40SISO-Ant1-5795-PASS

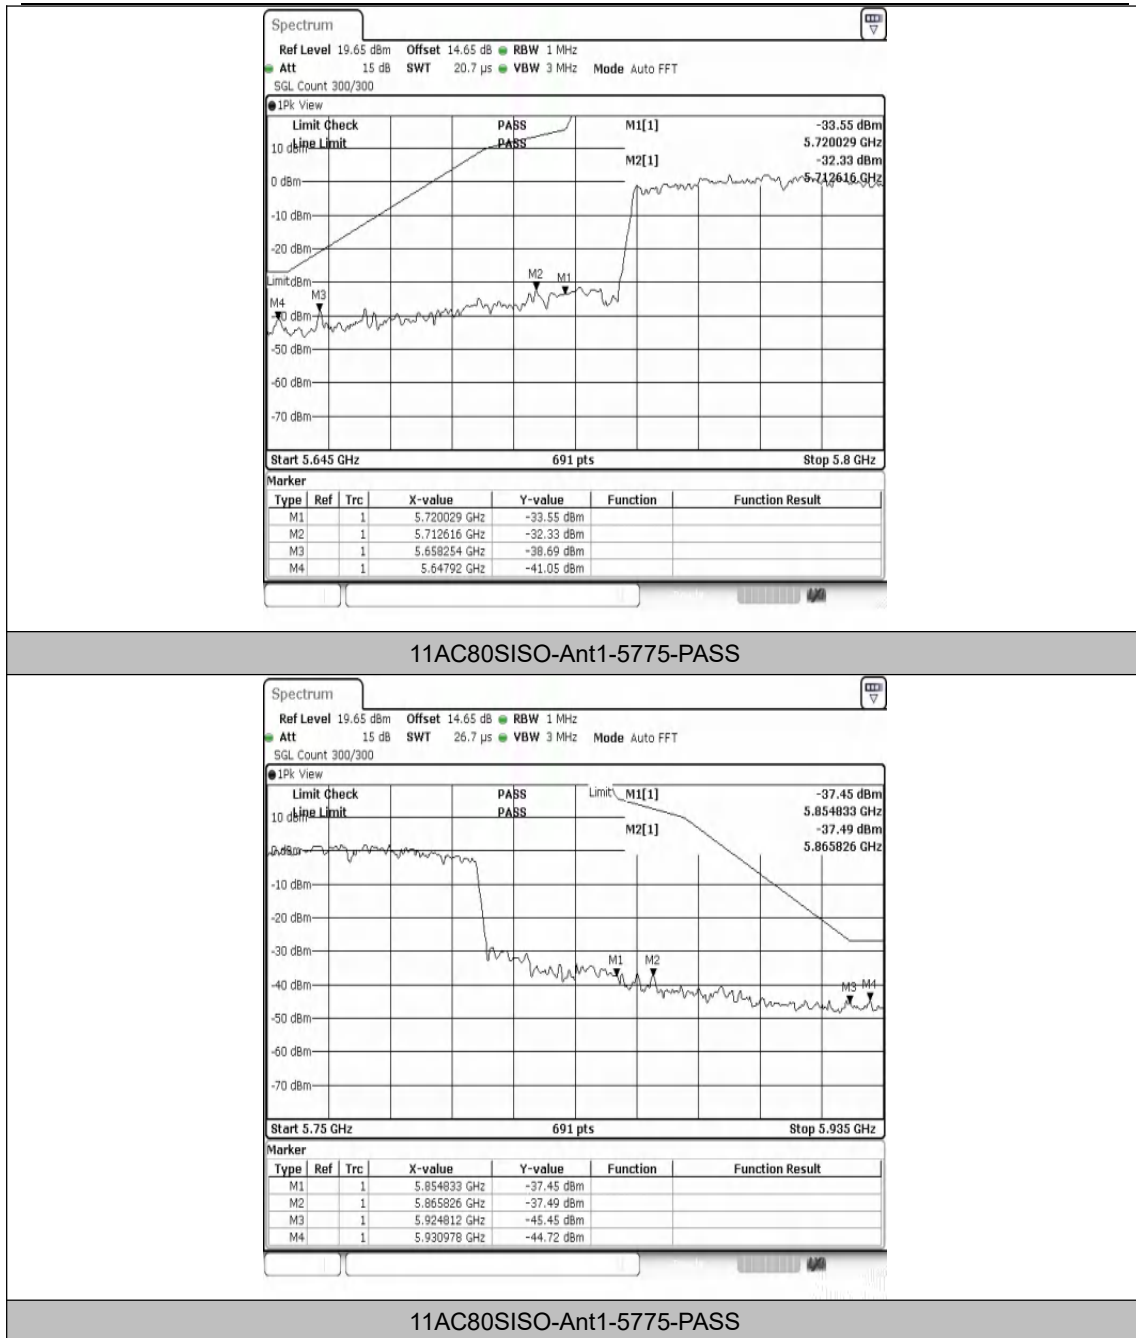

---End---