






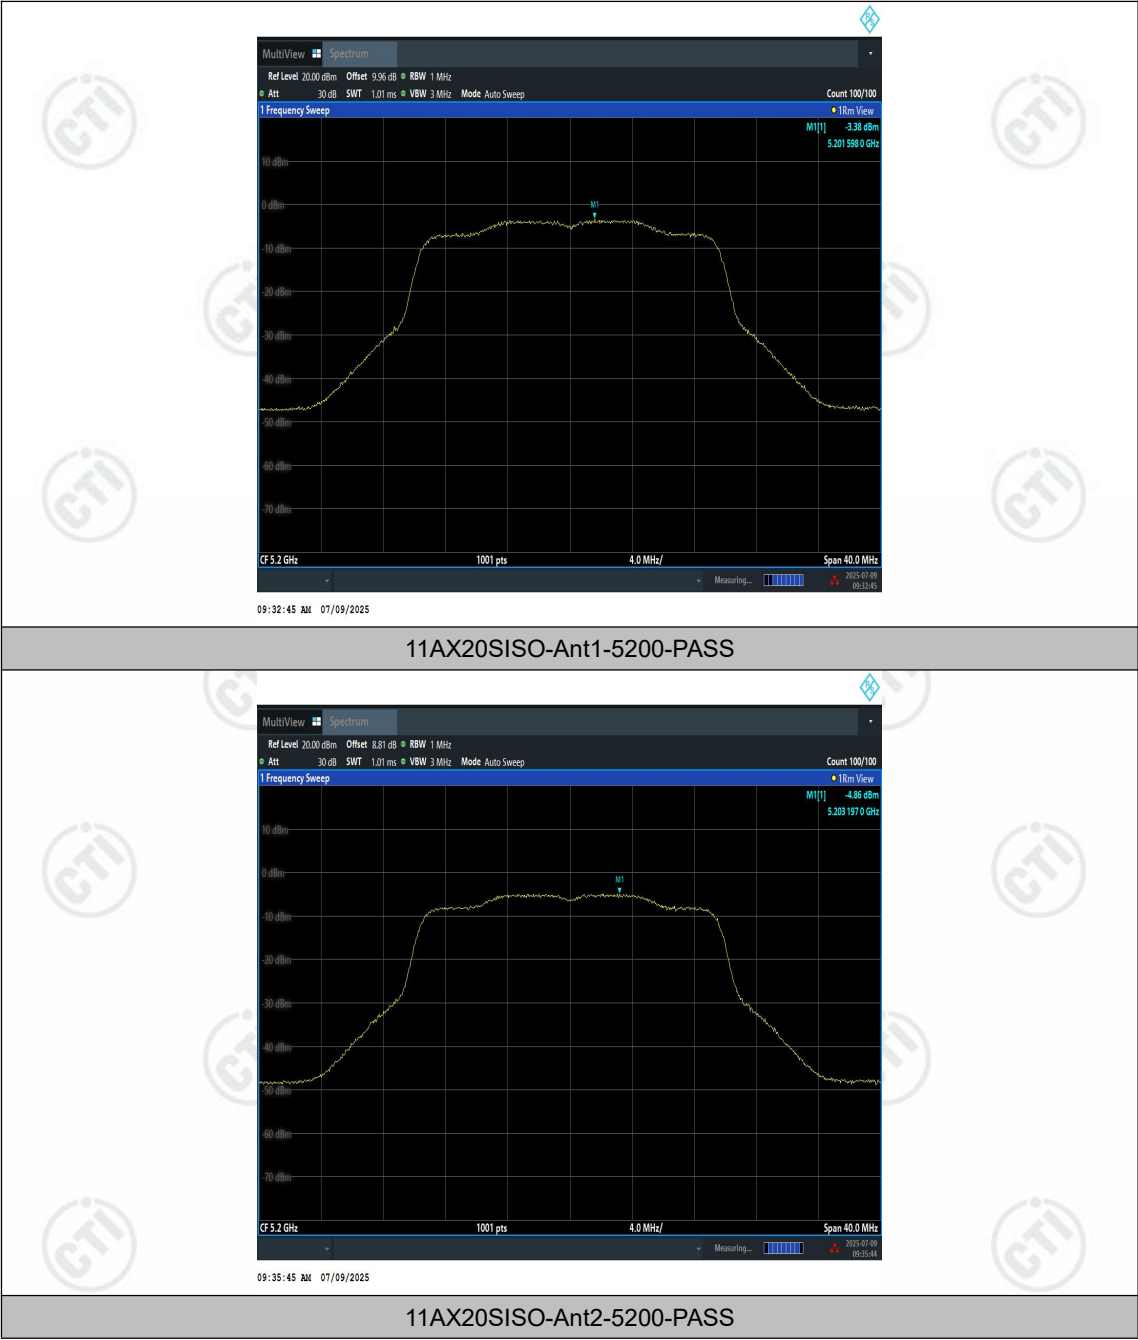


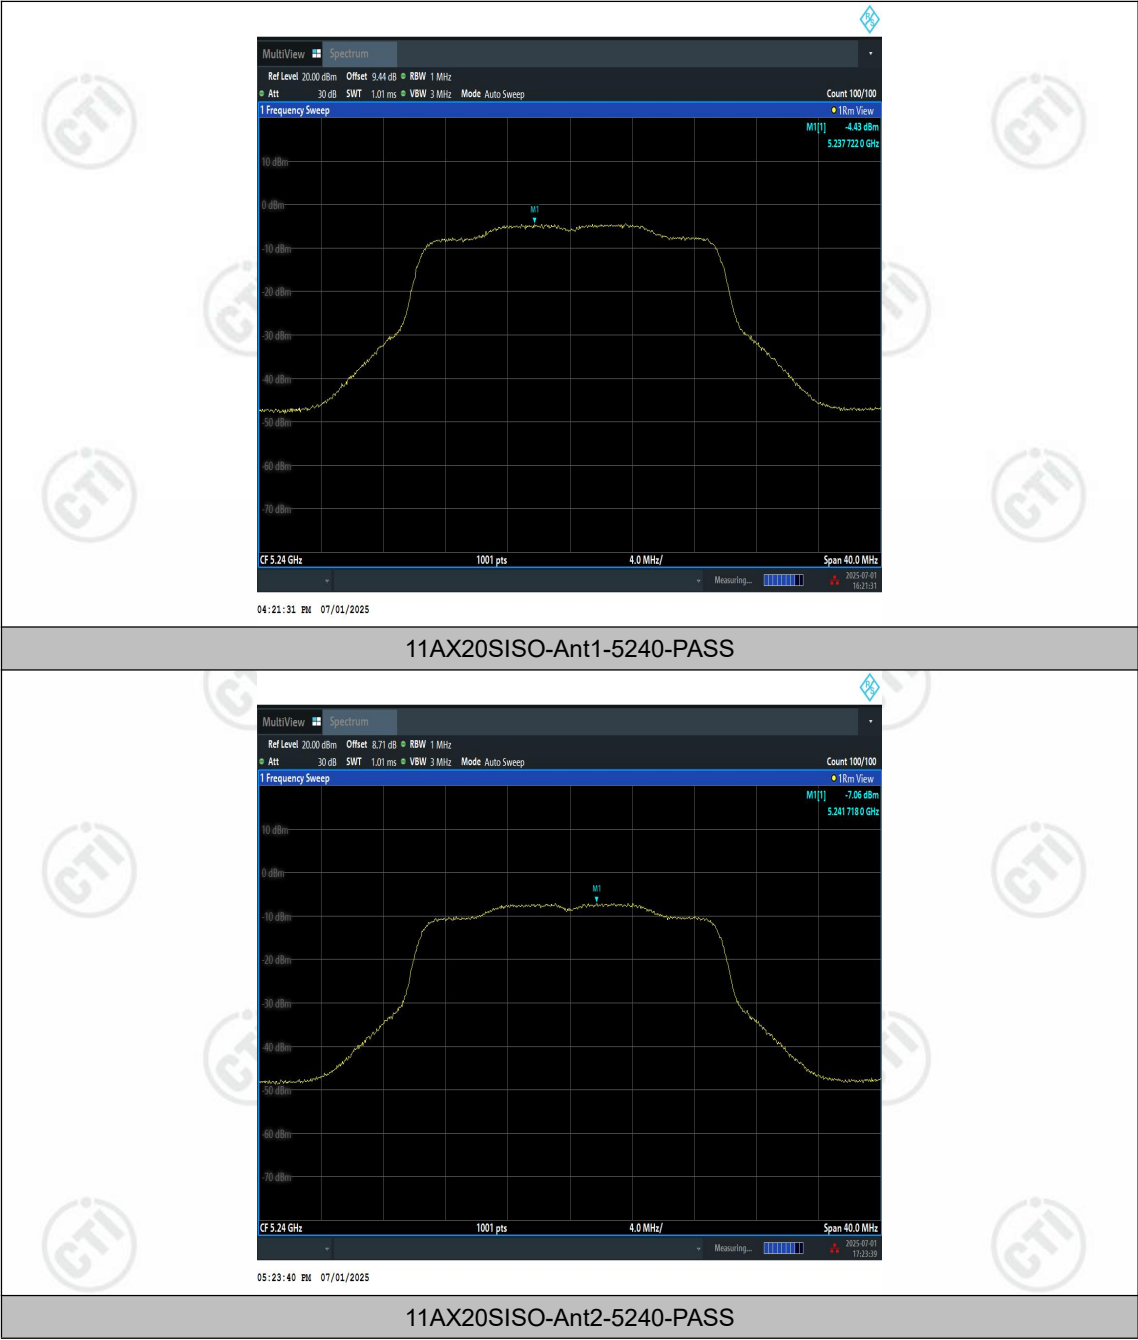


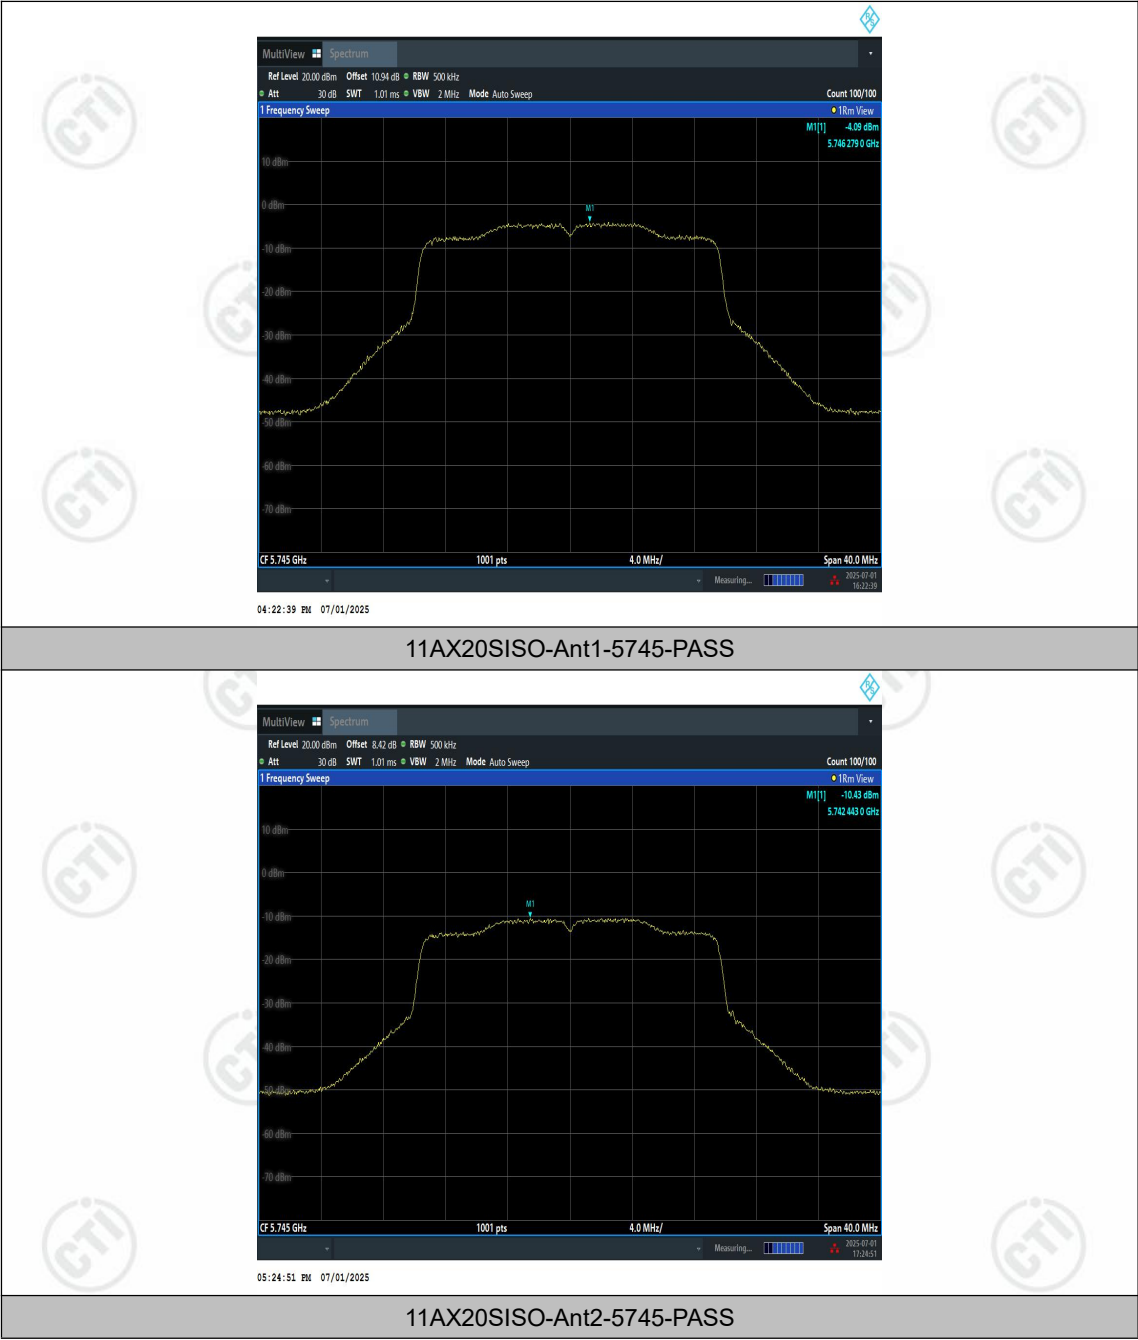


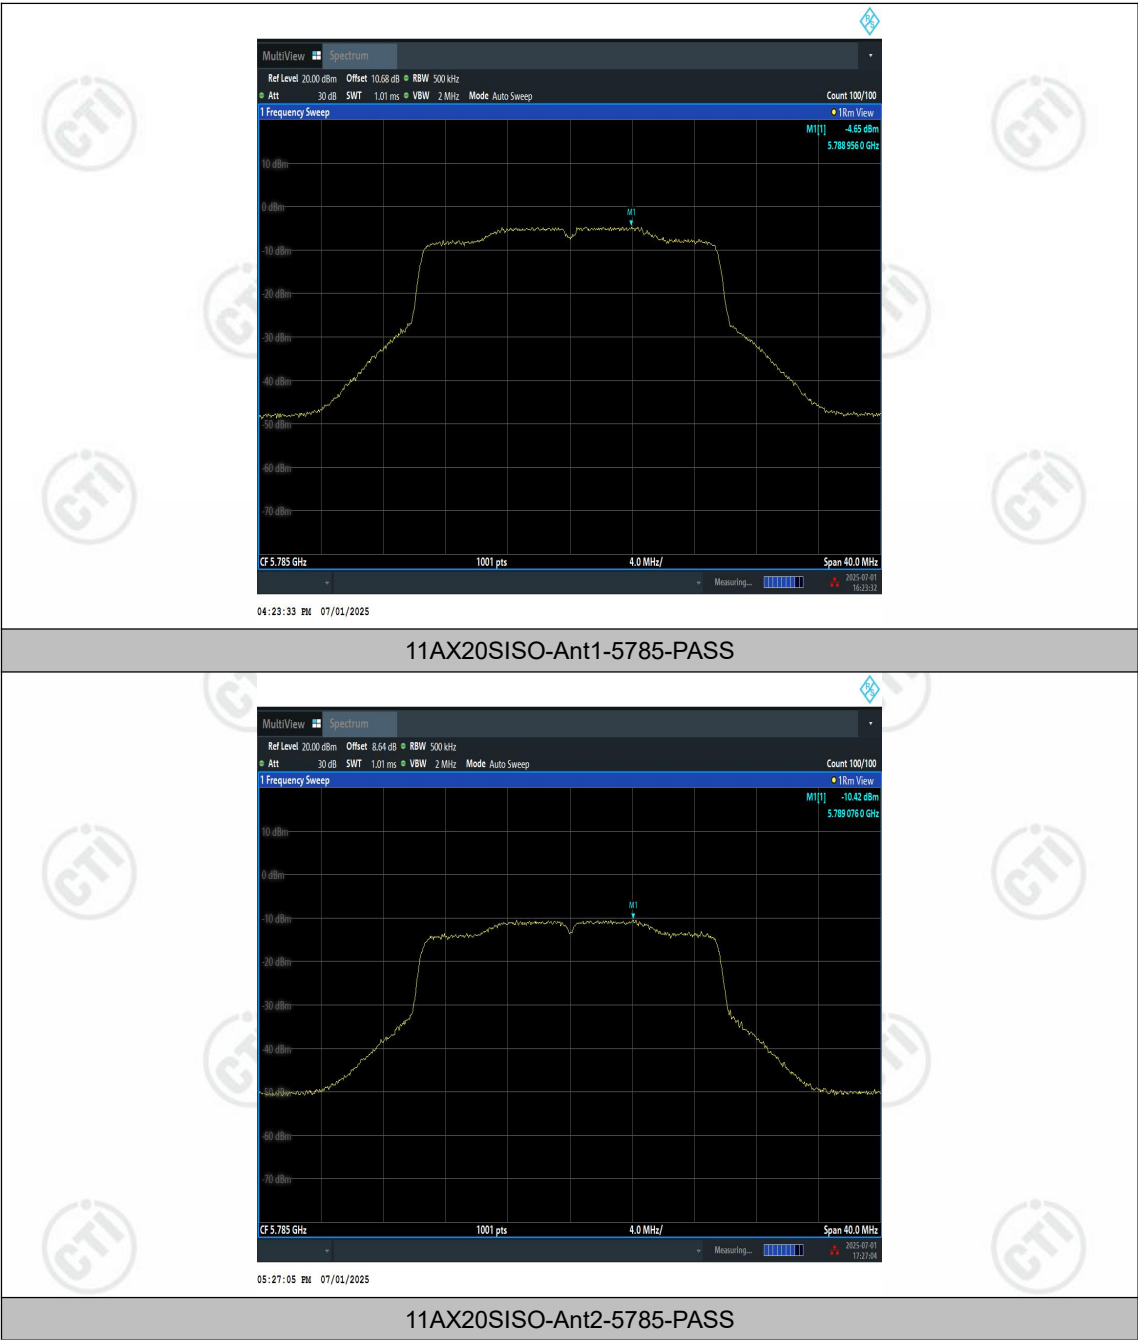



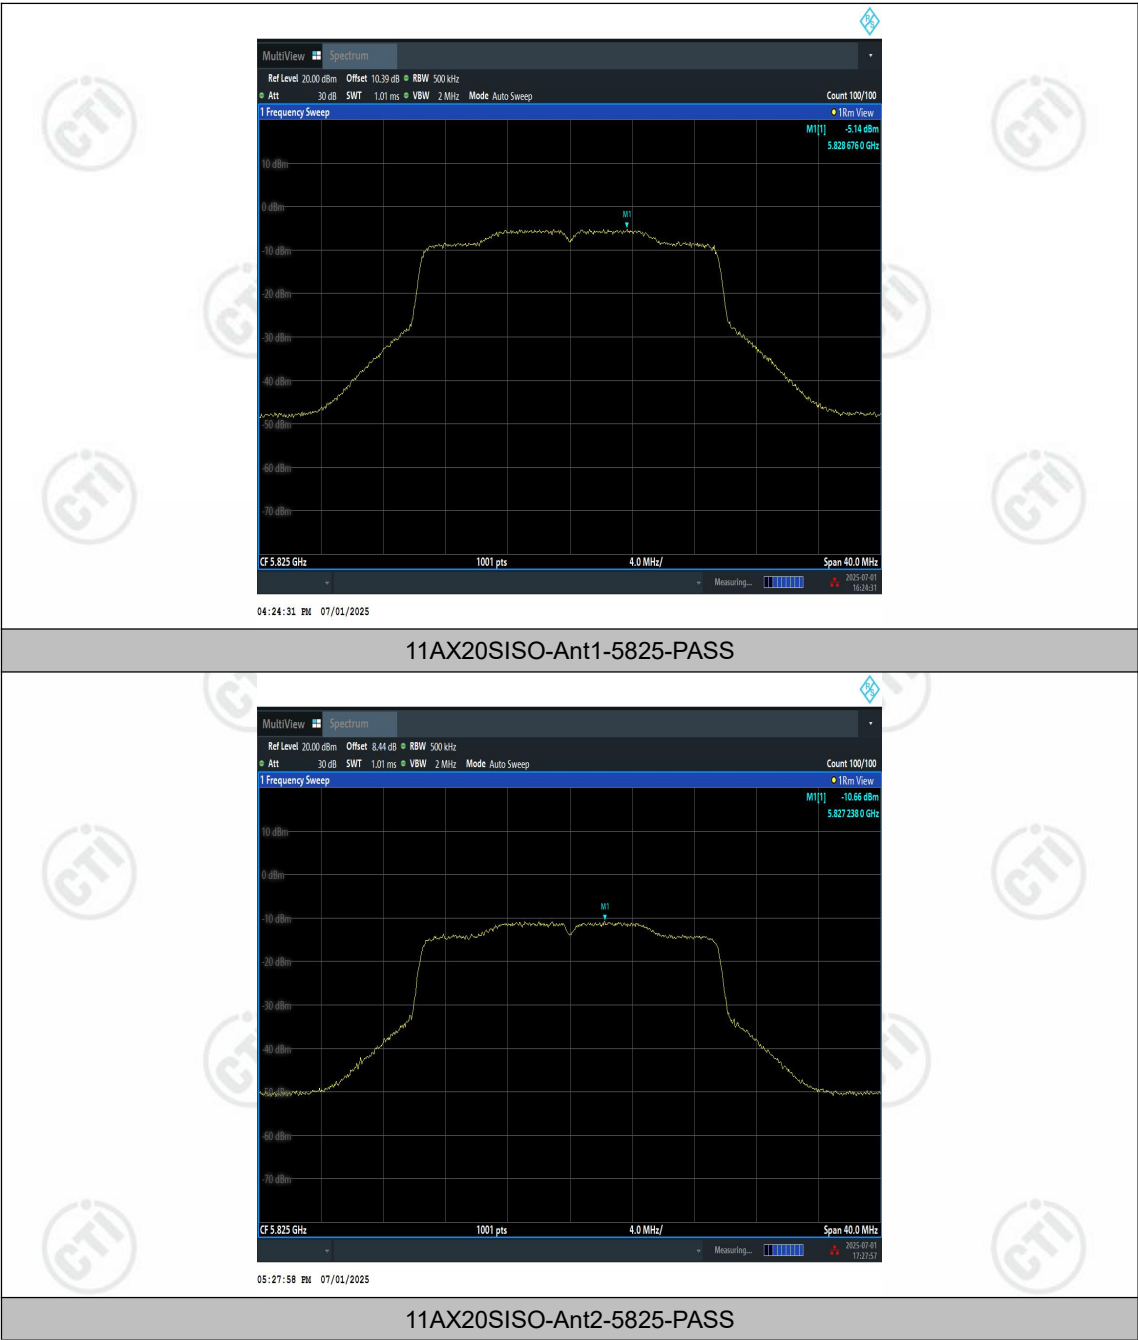


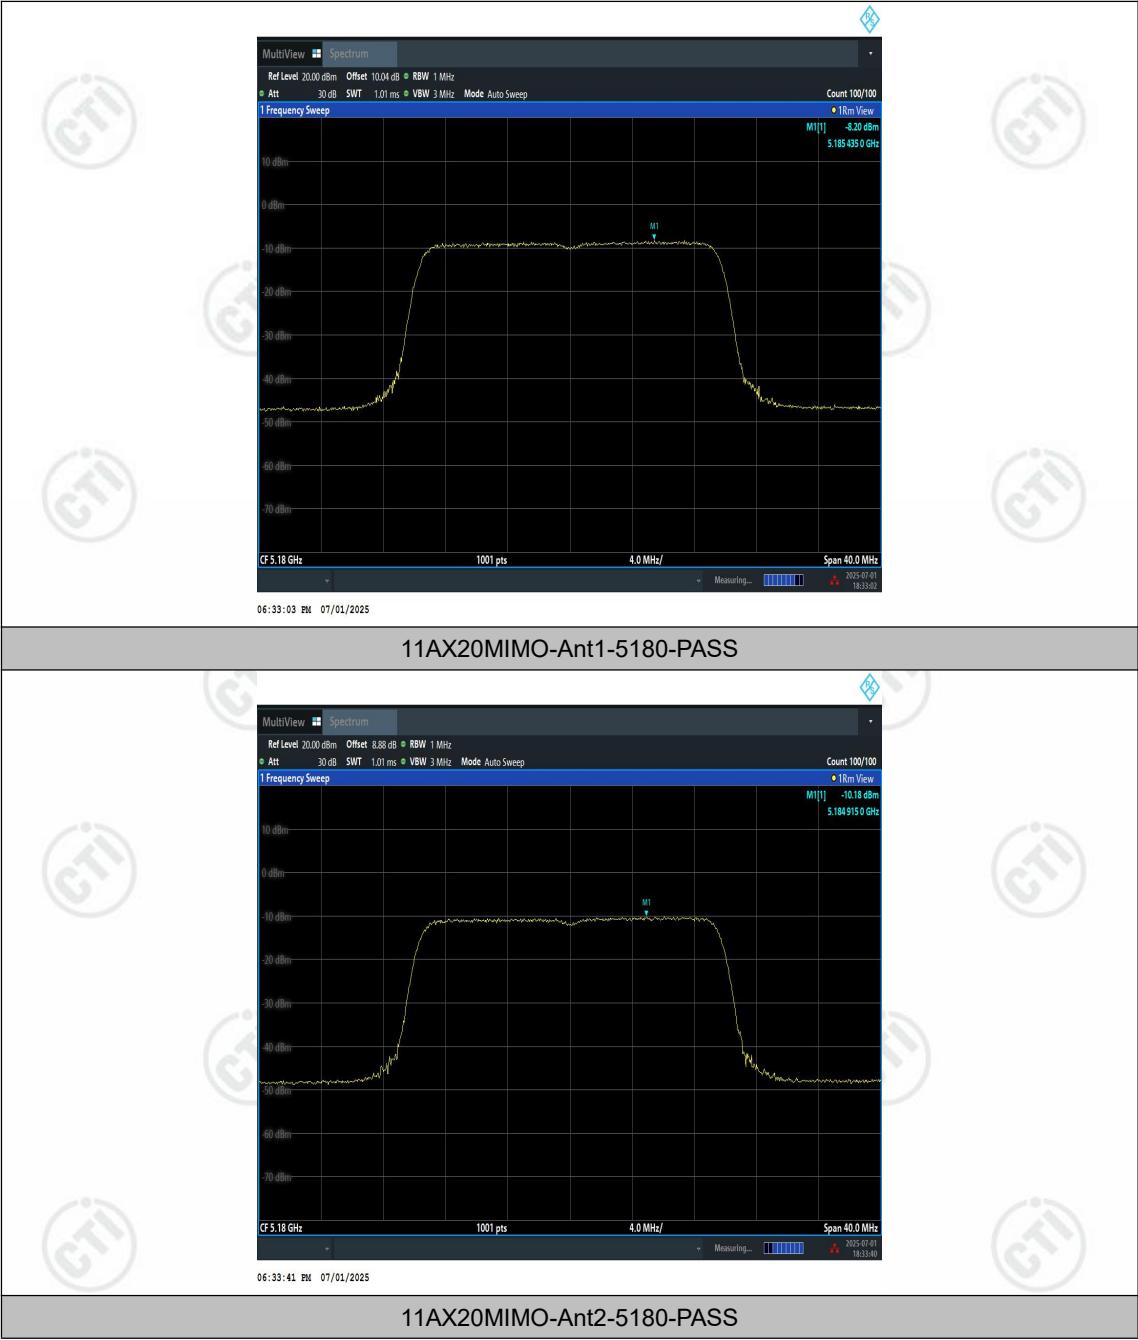


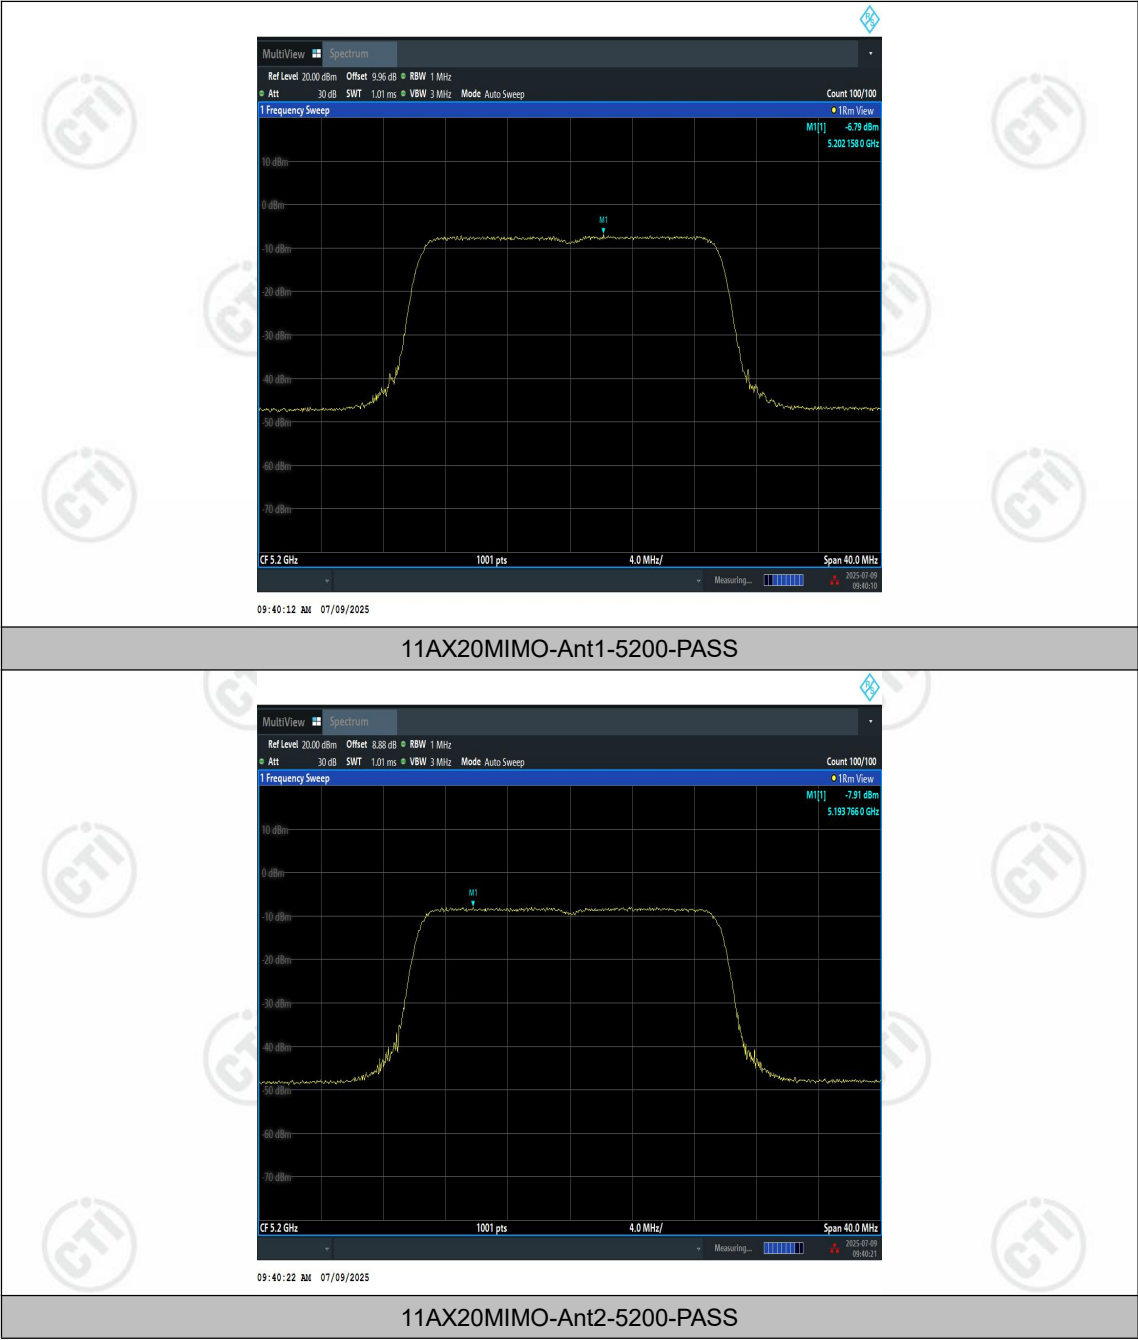


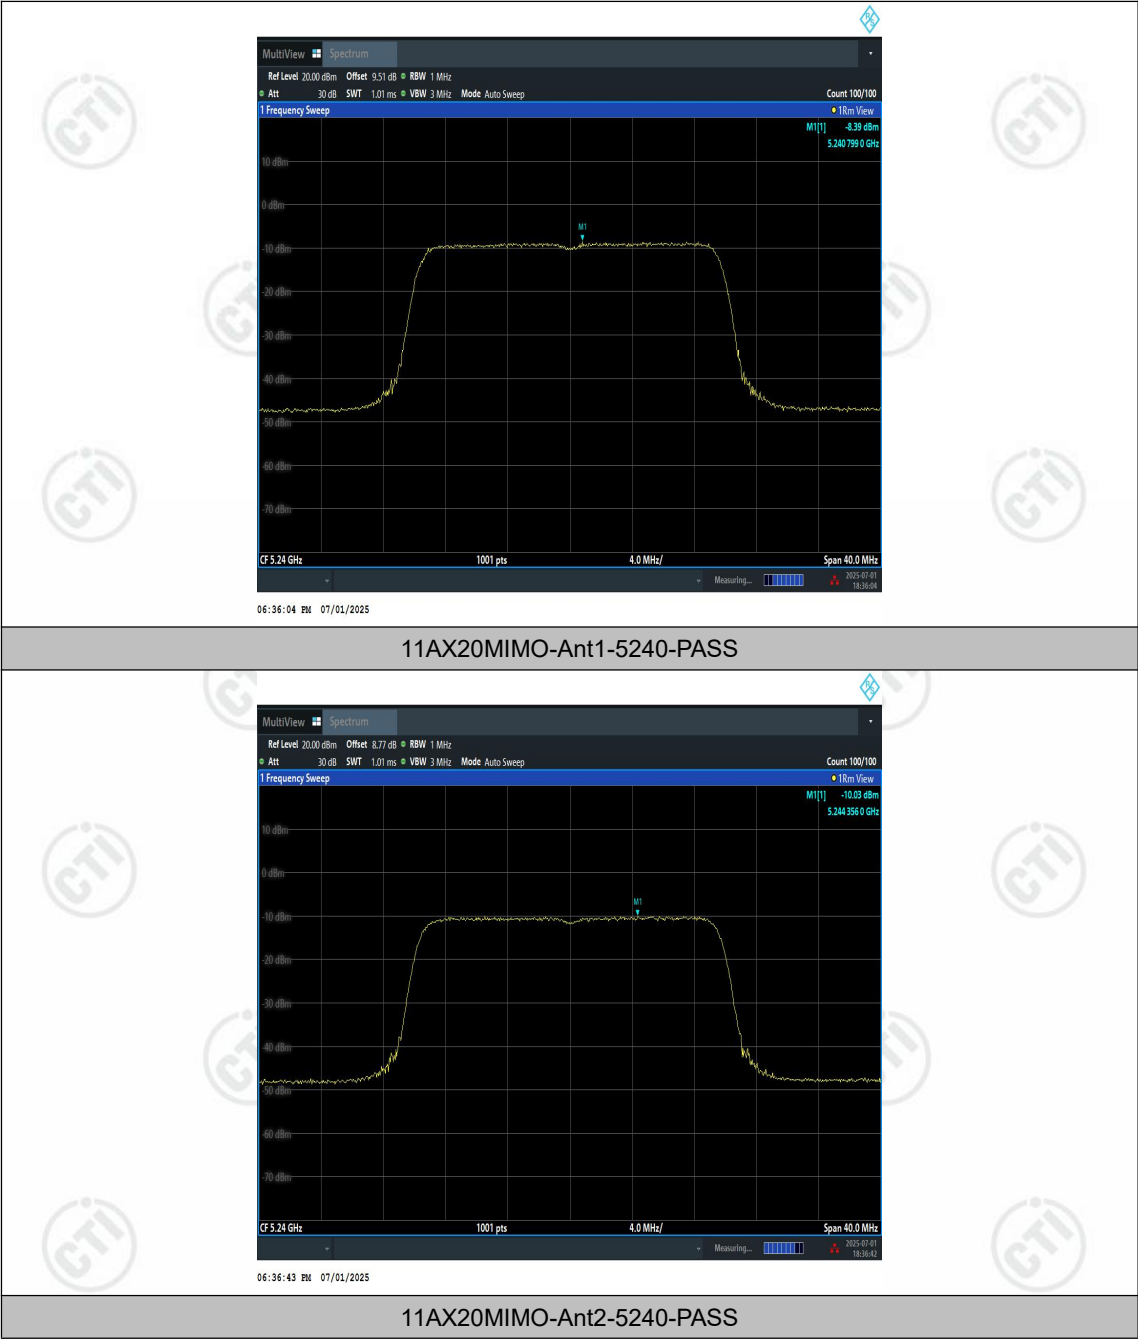


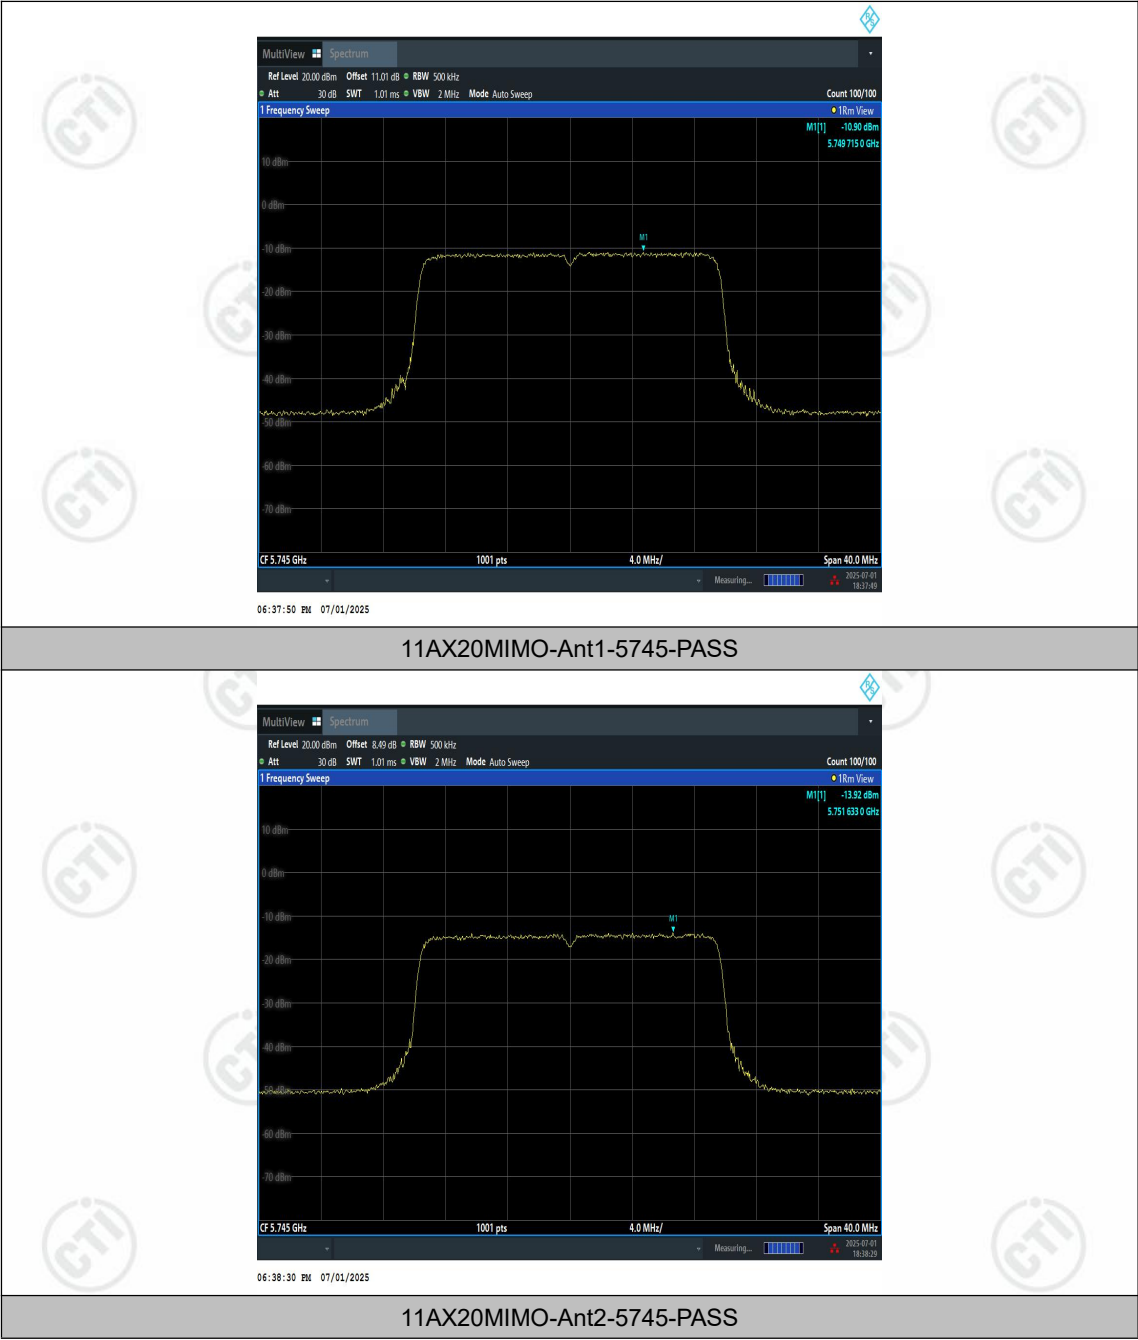





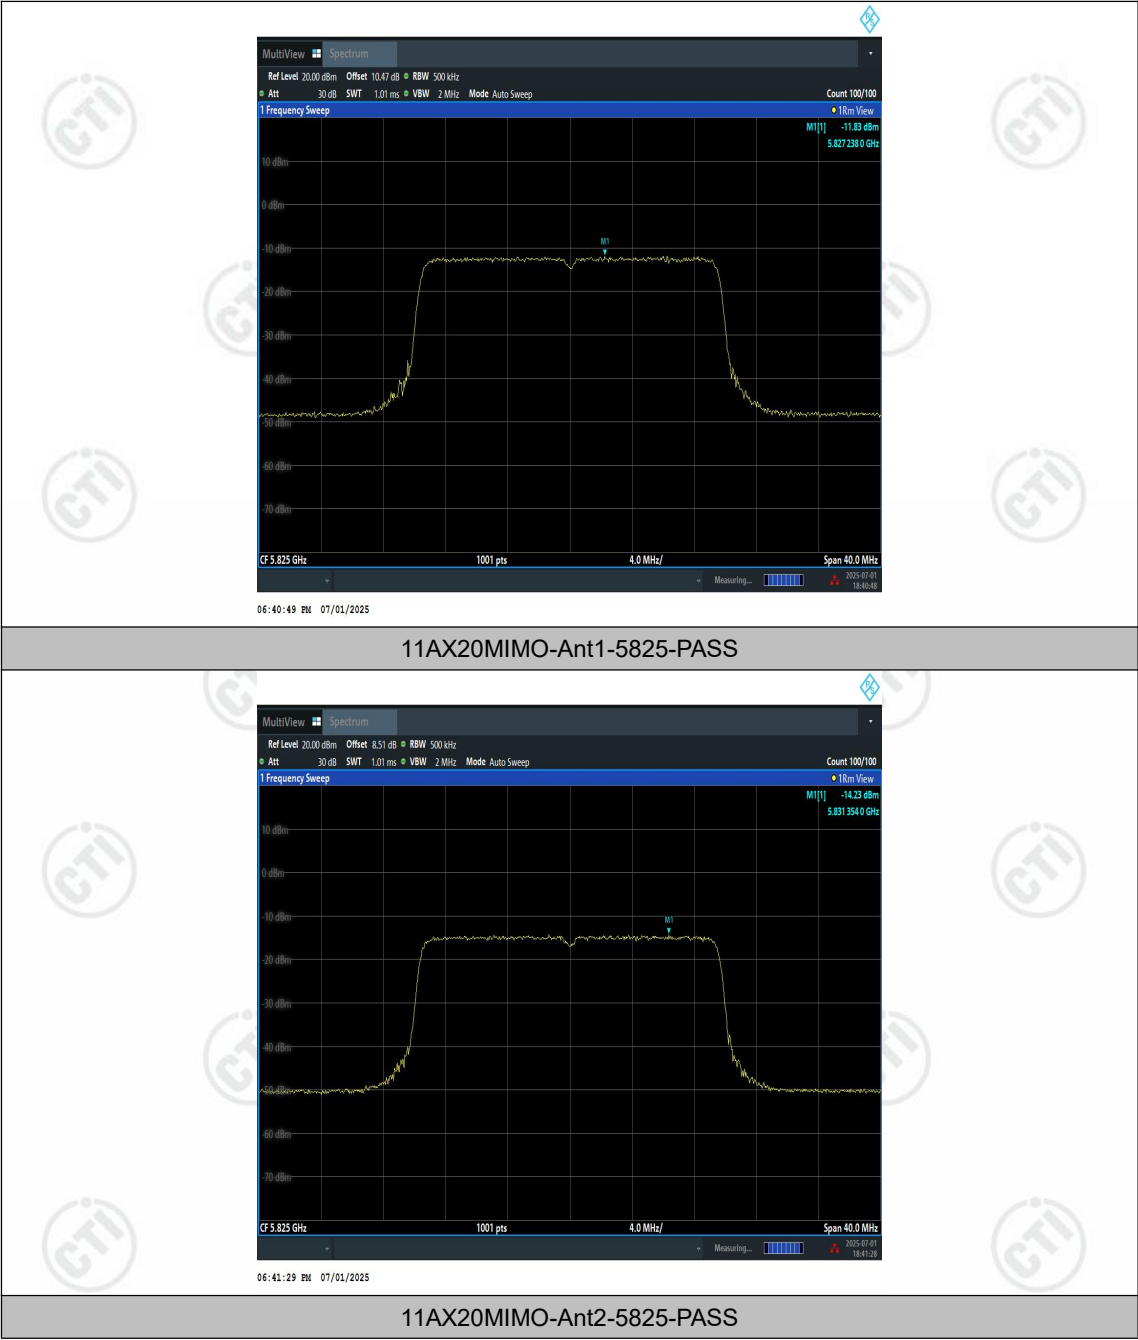


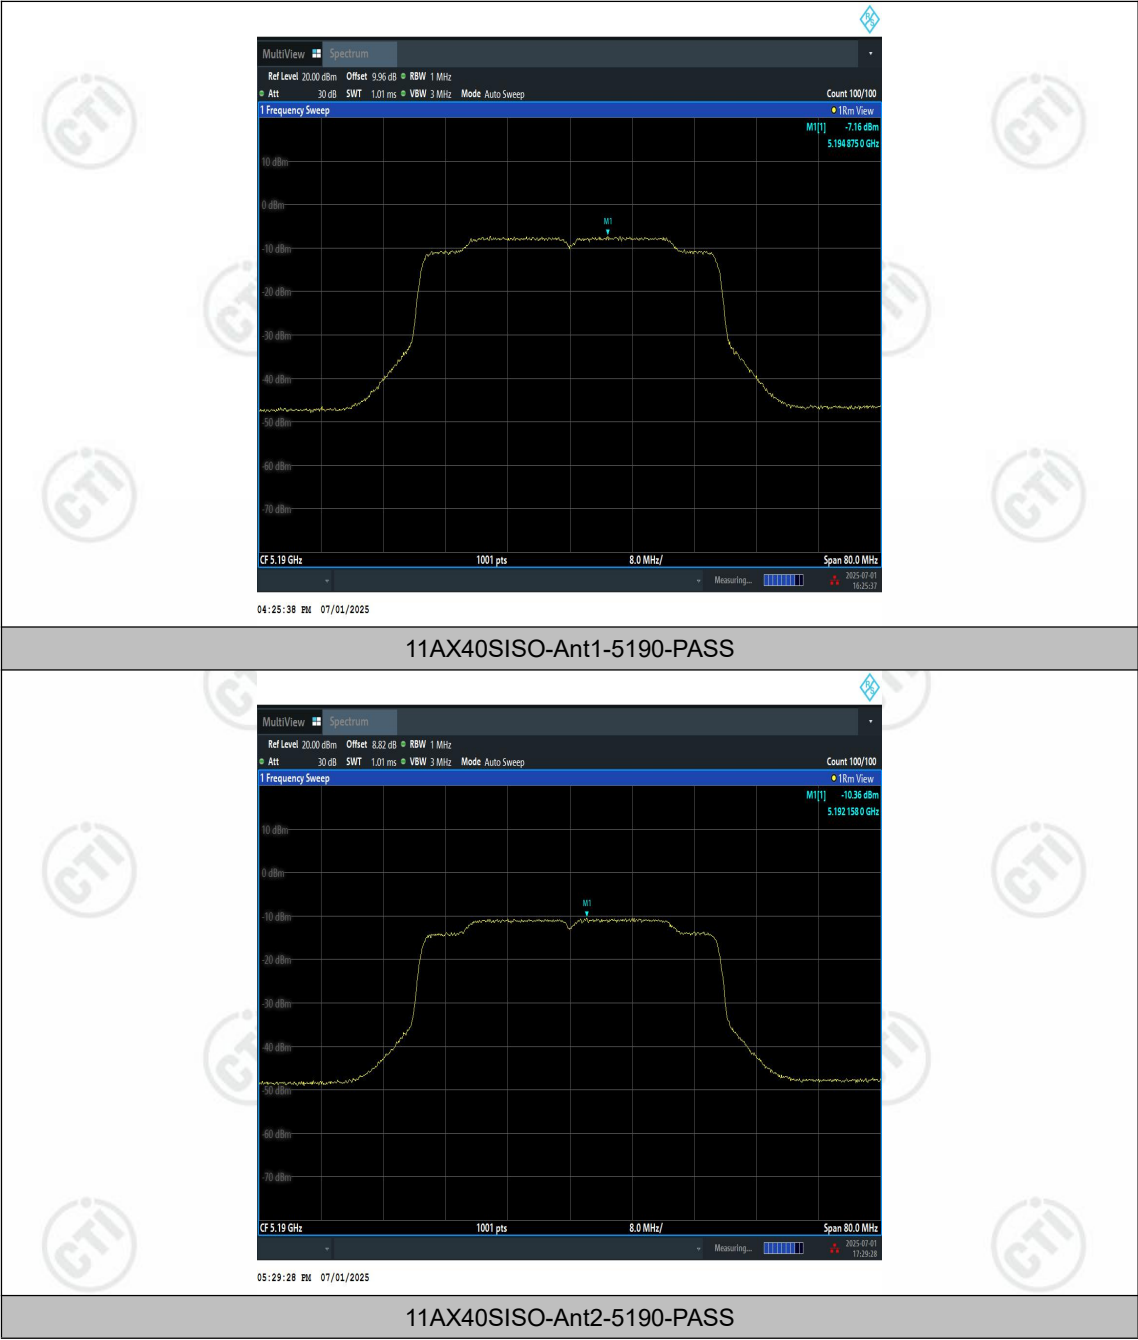


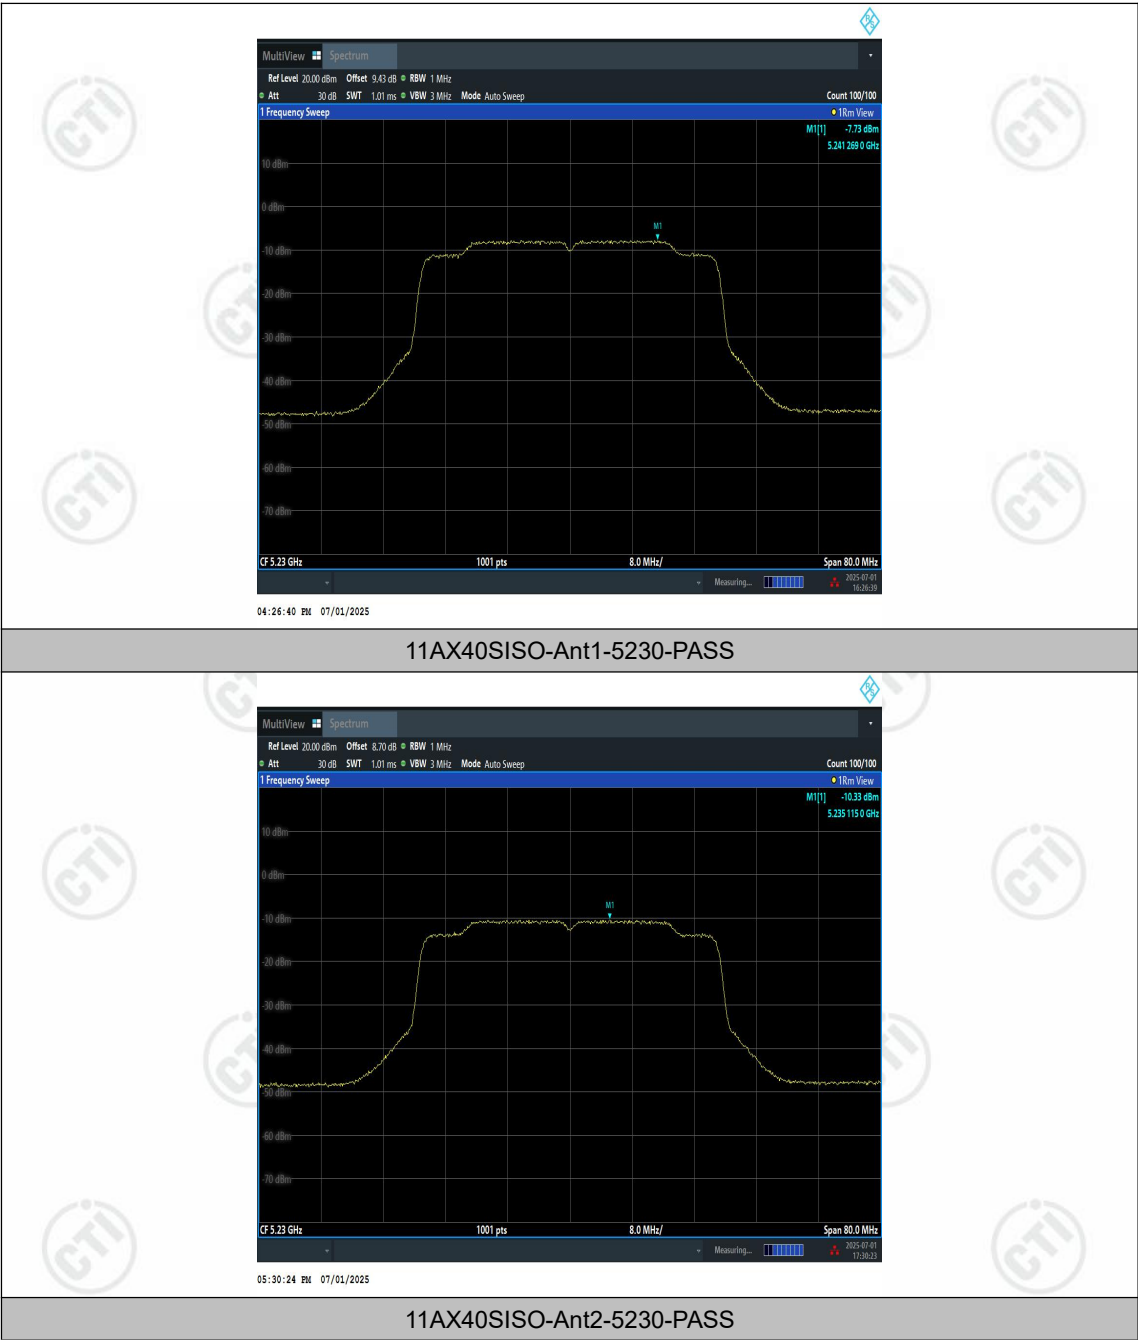

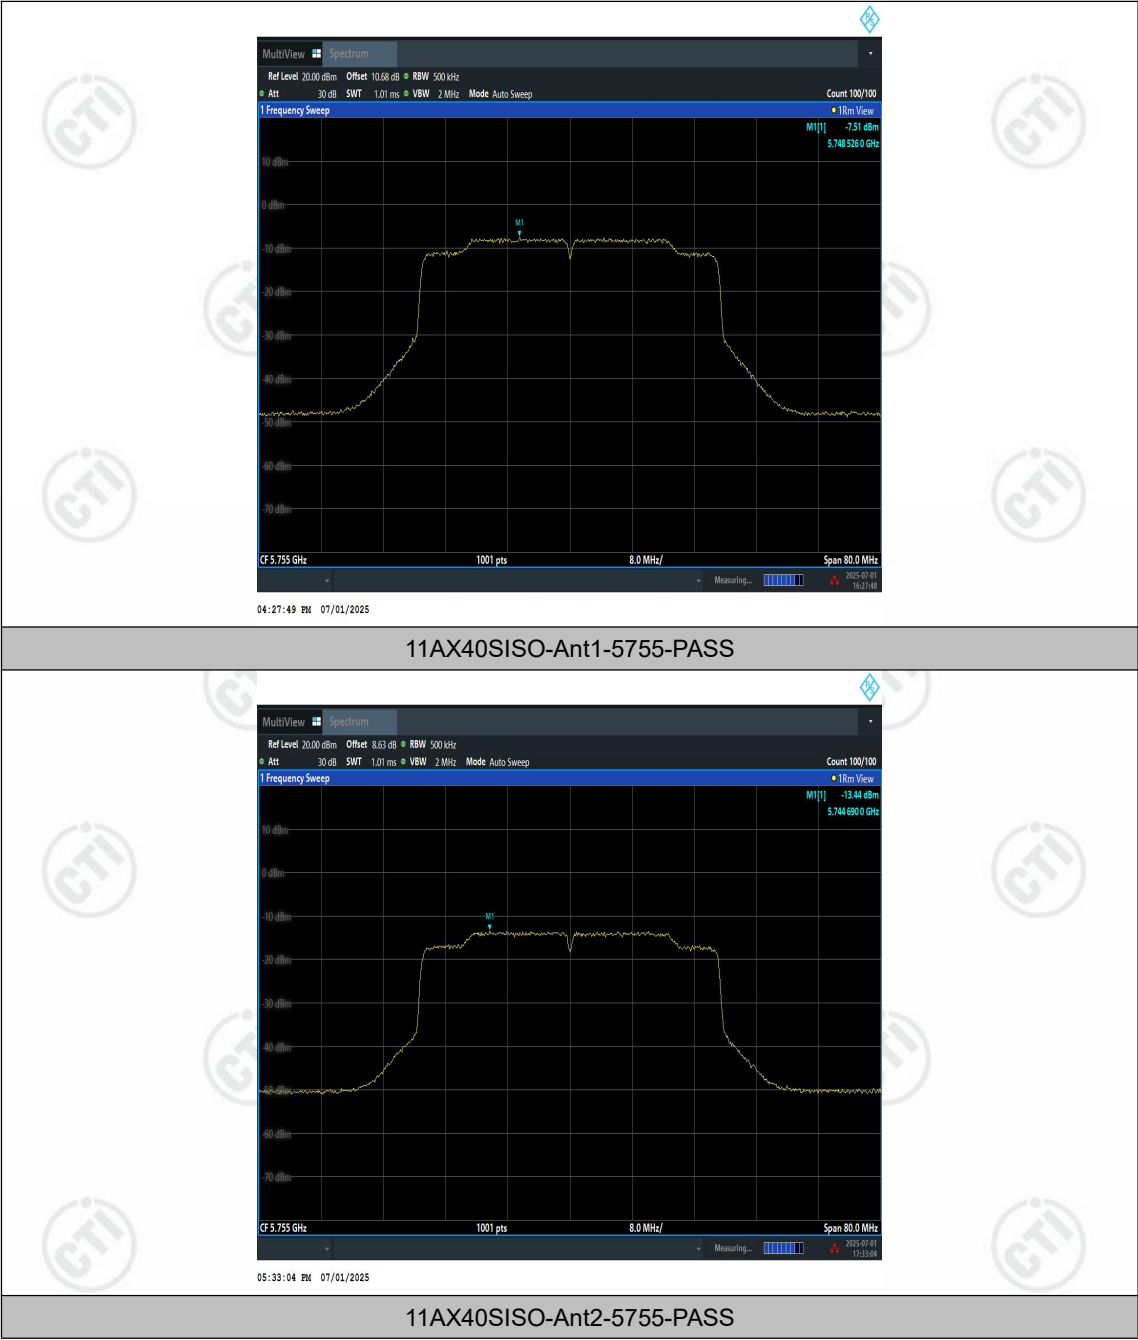

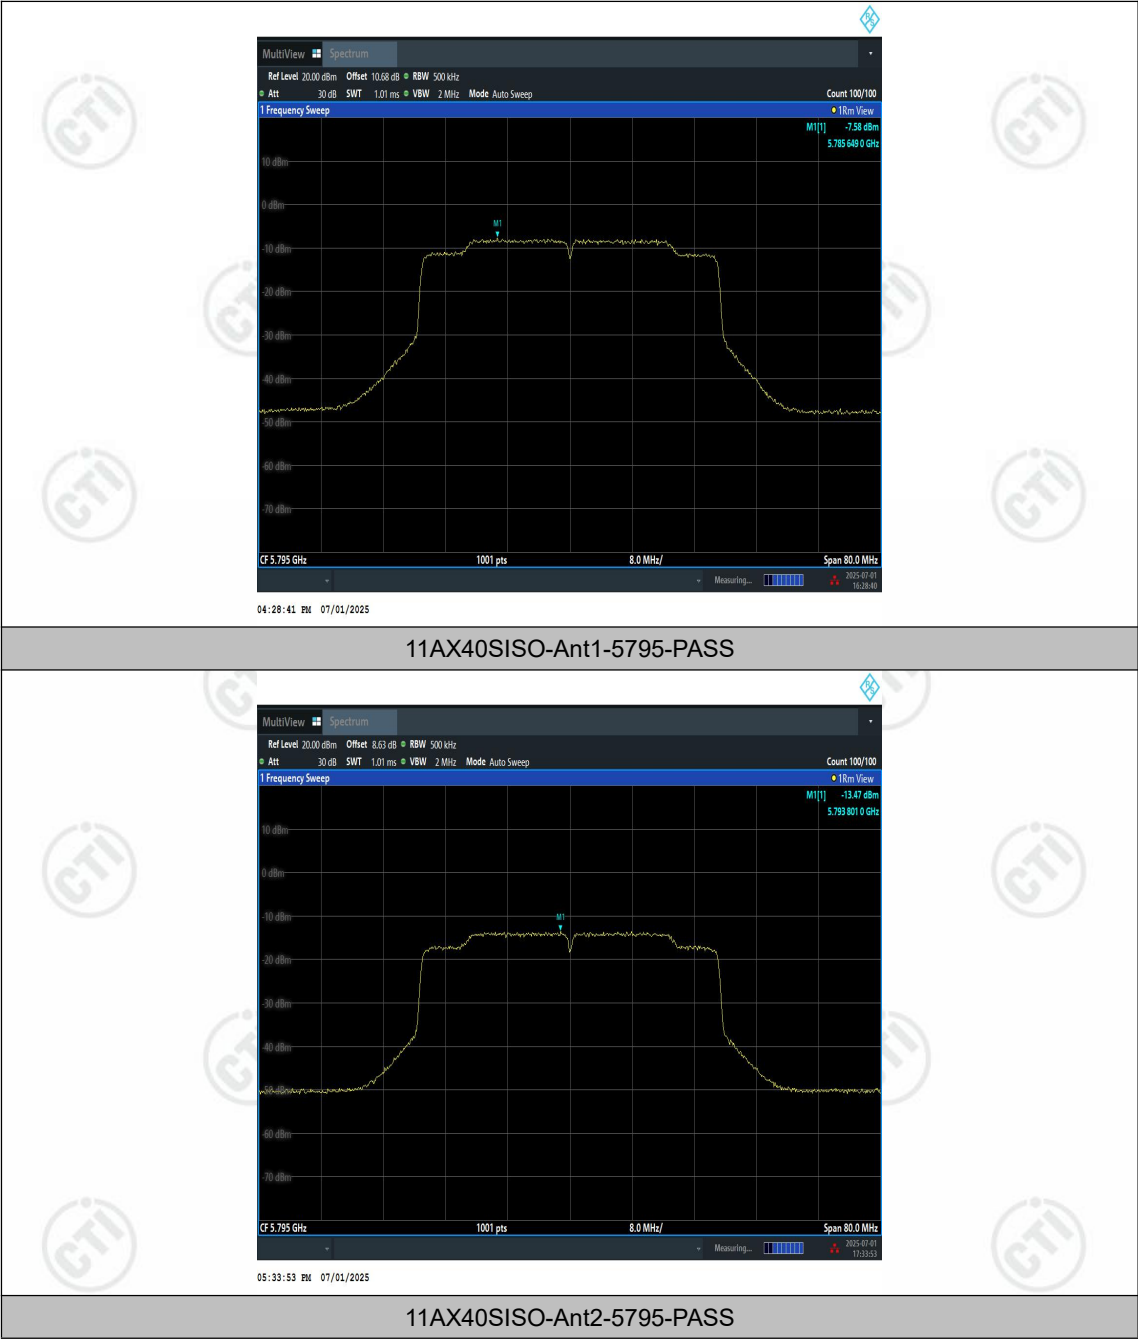


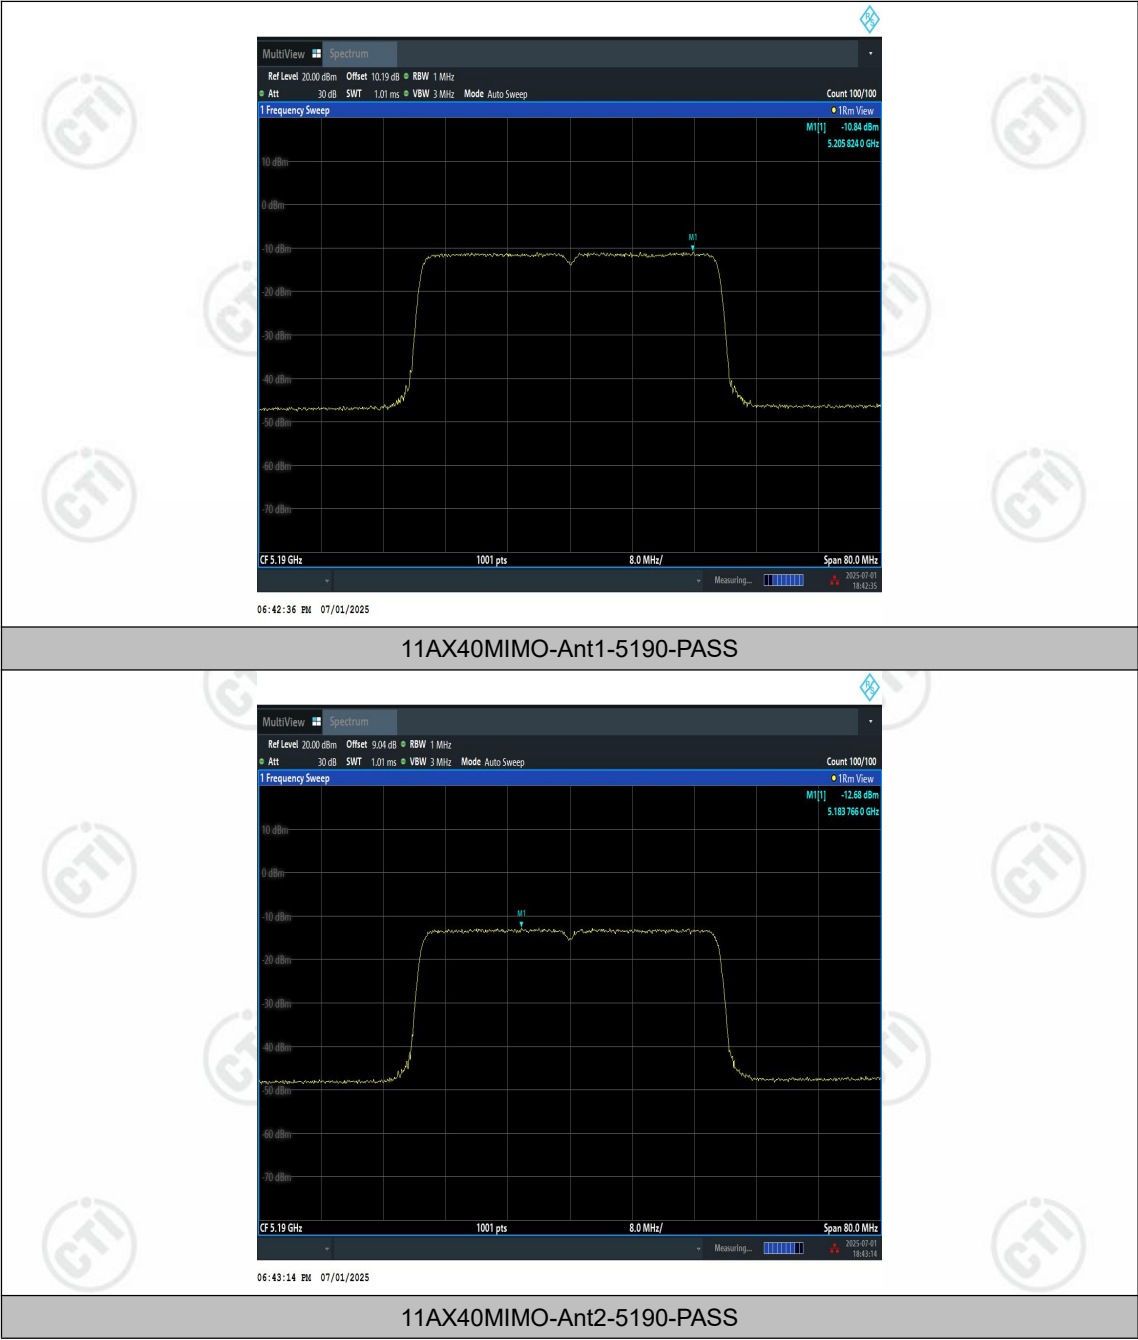


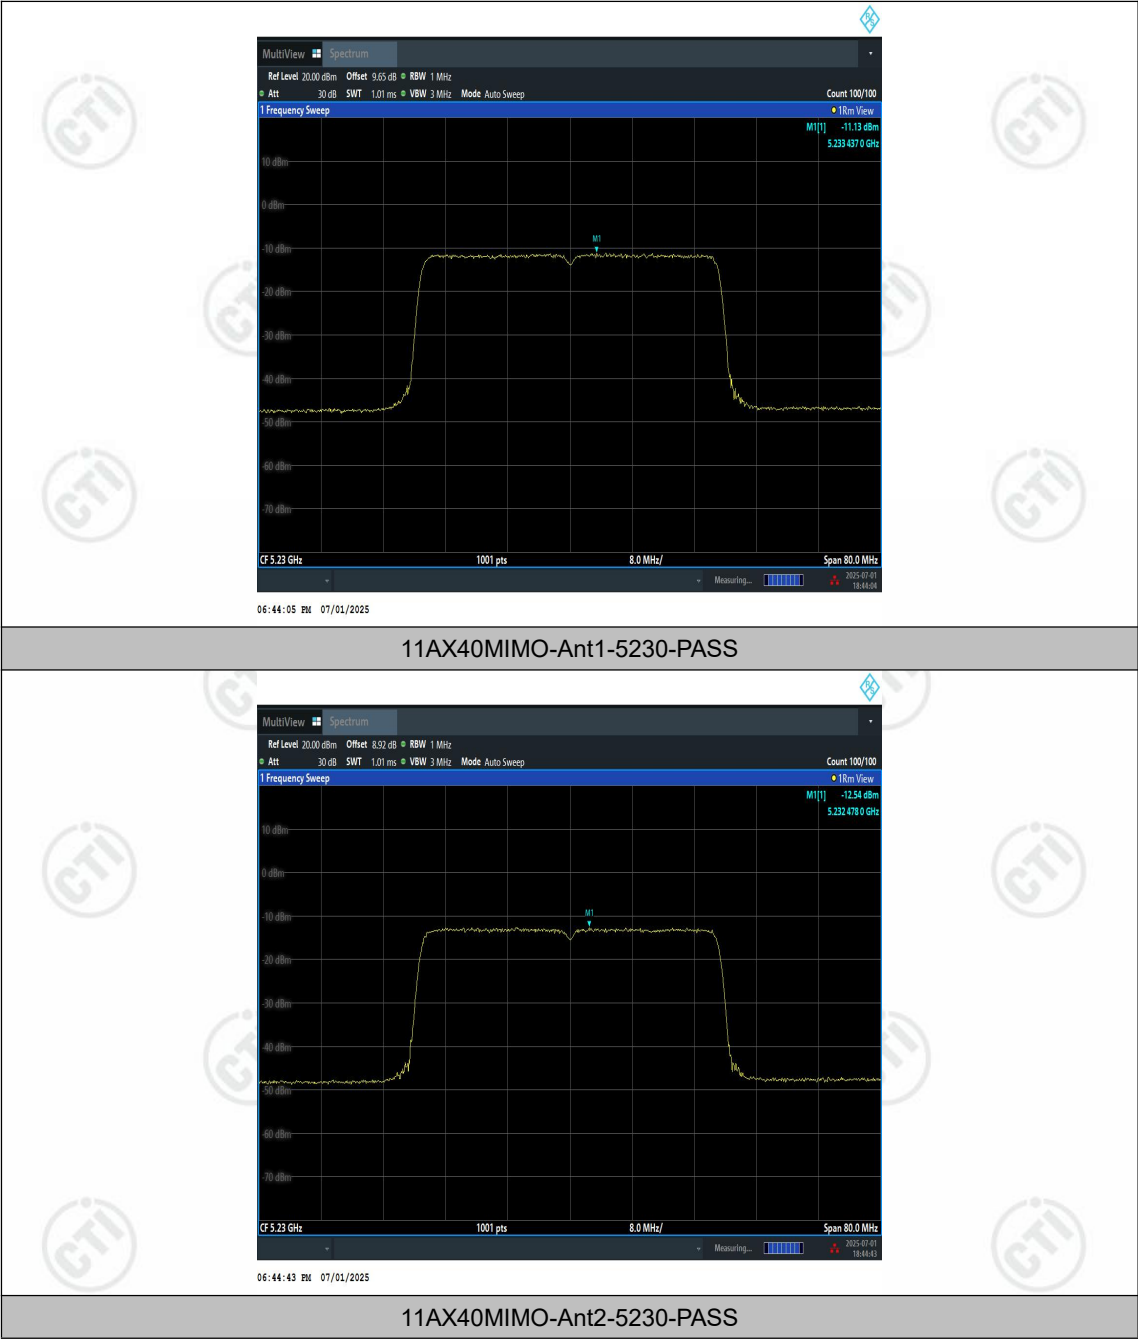







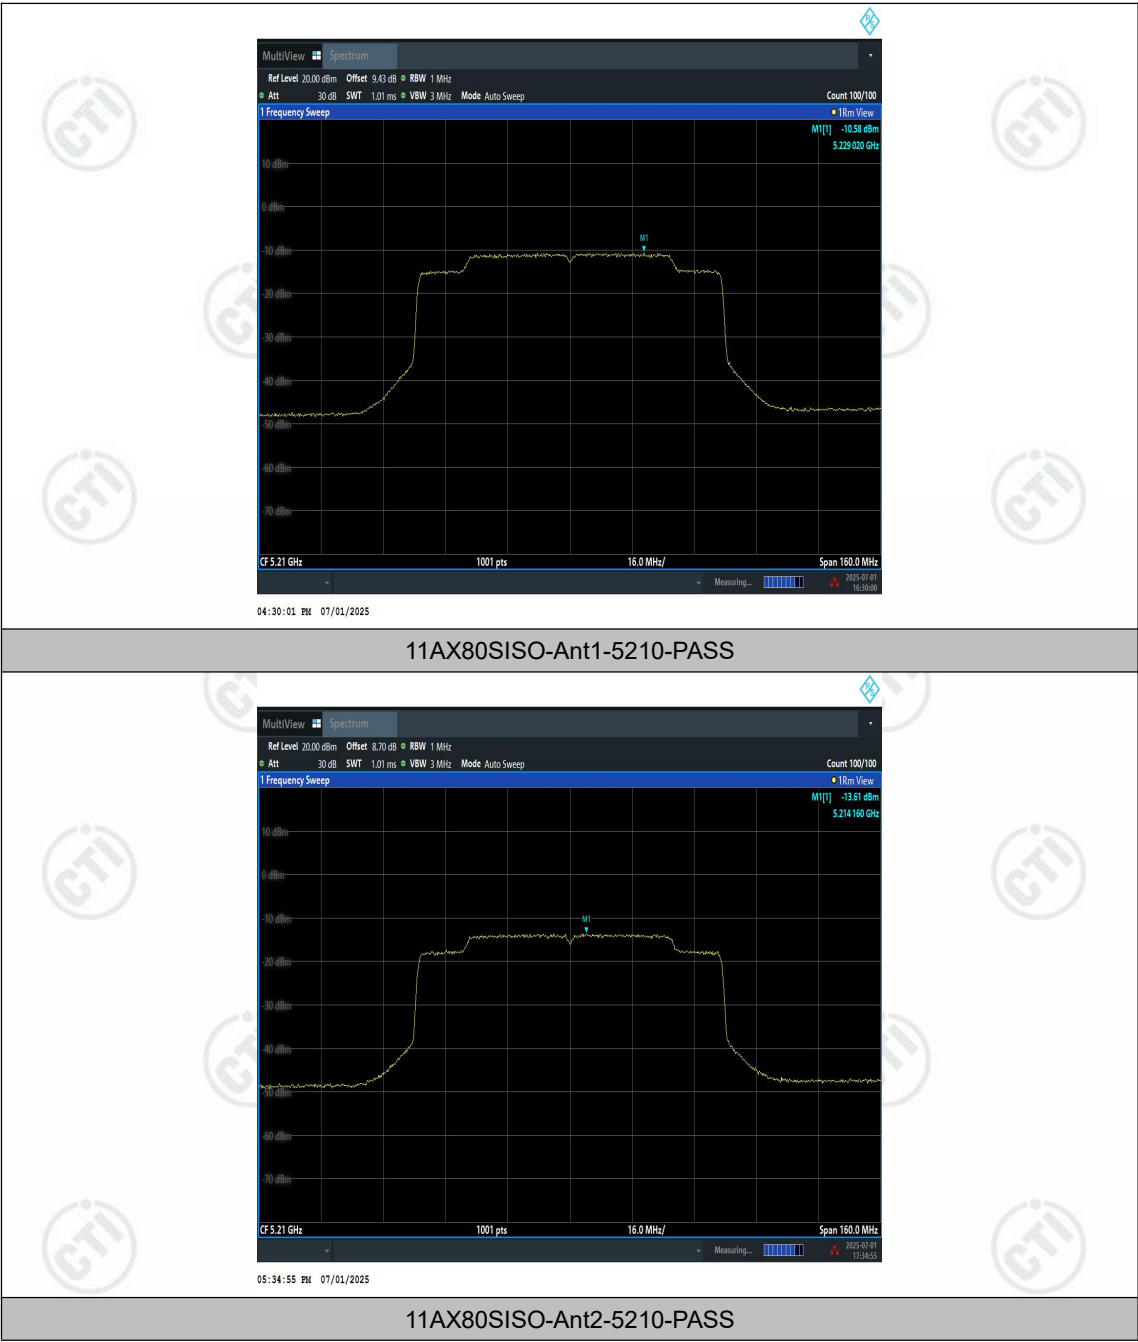


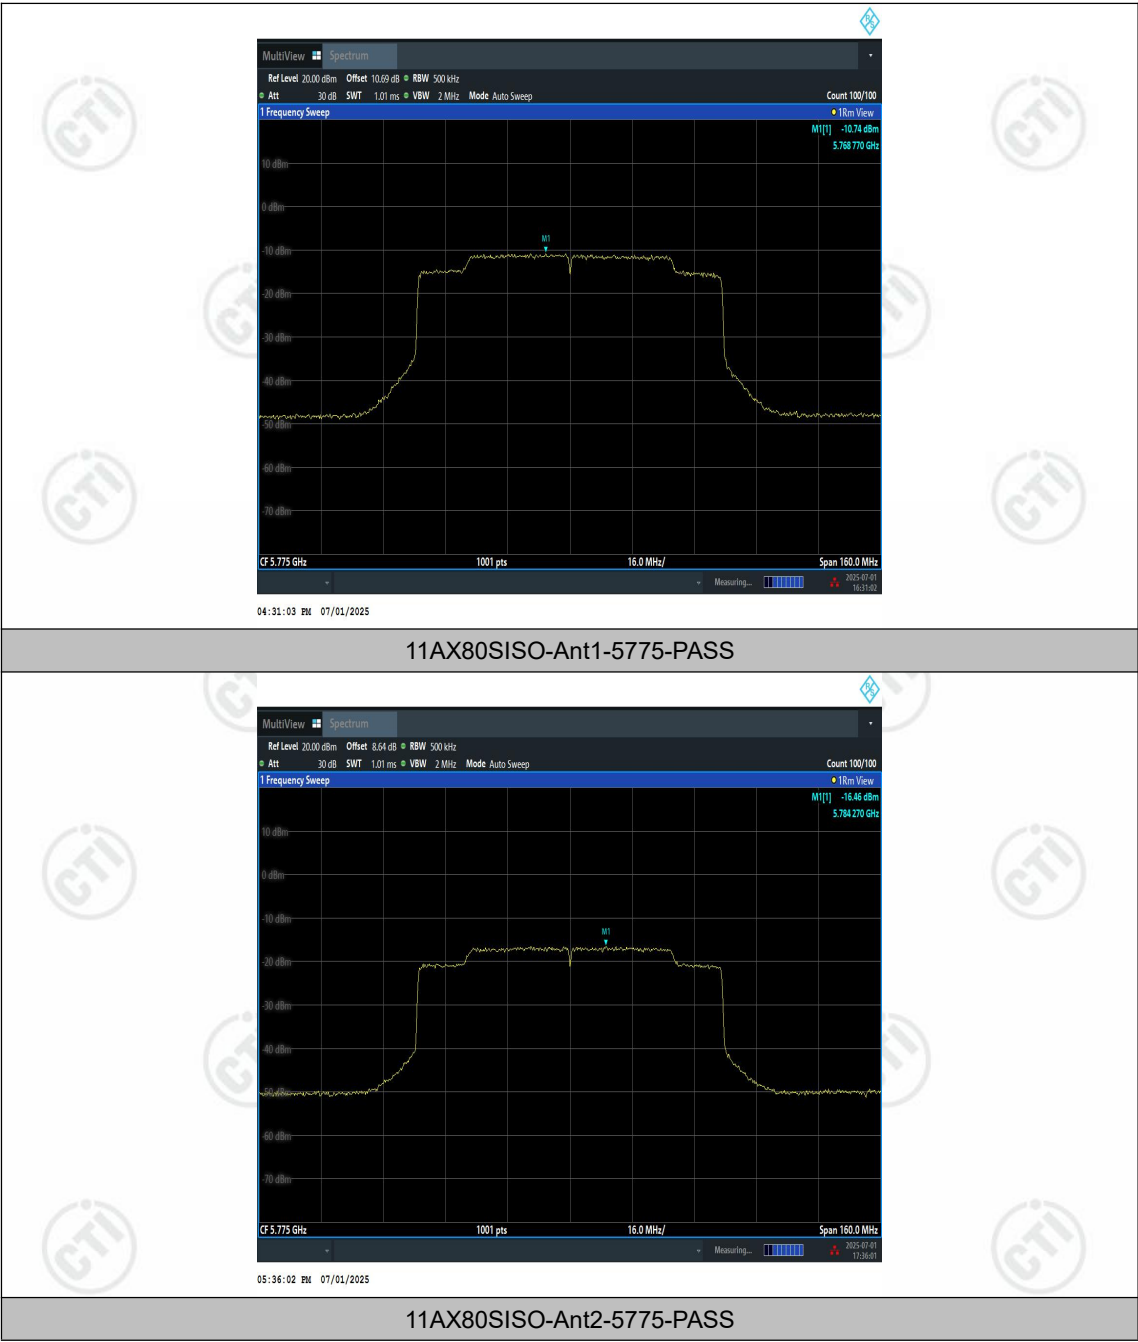

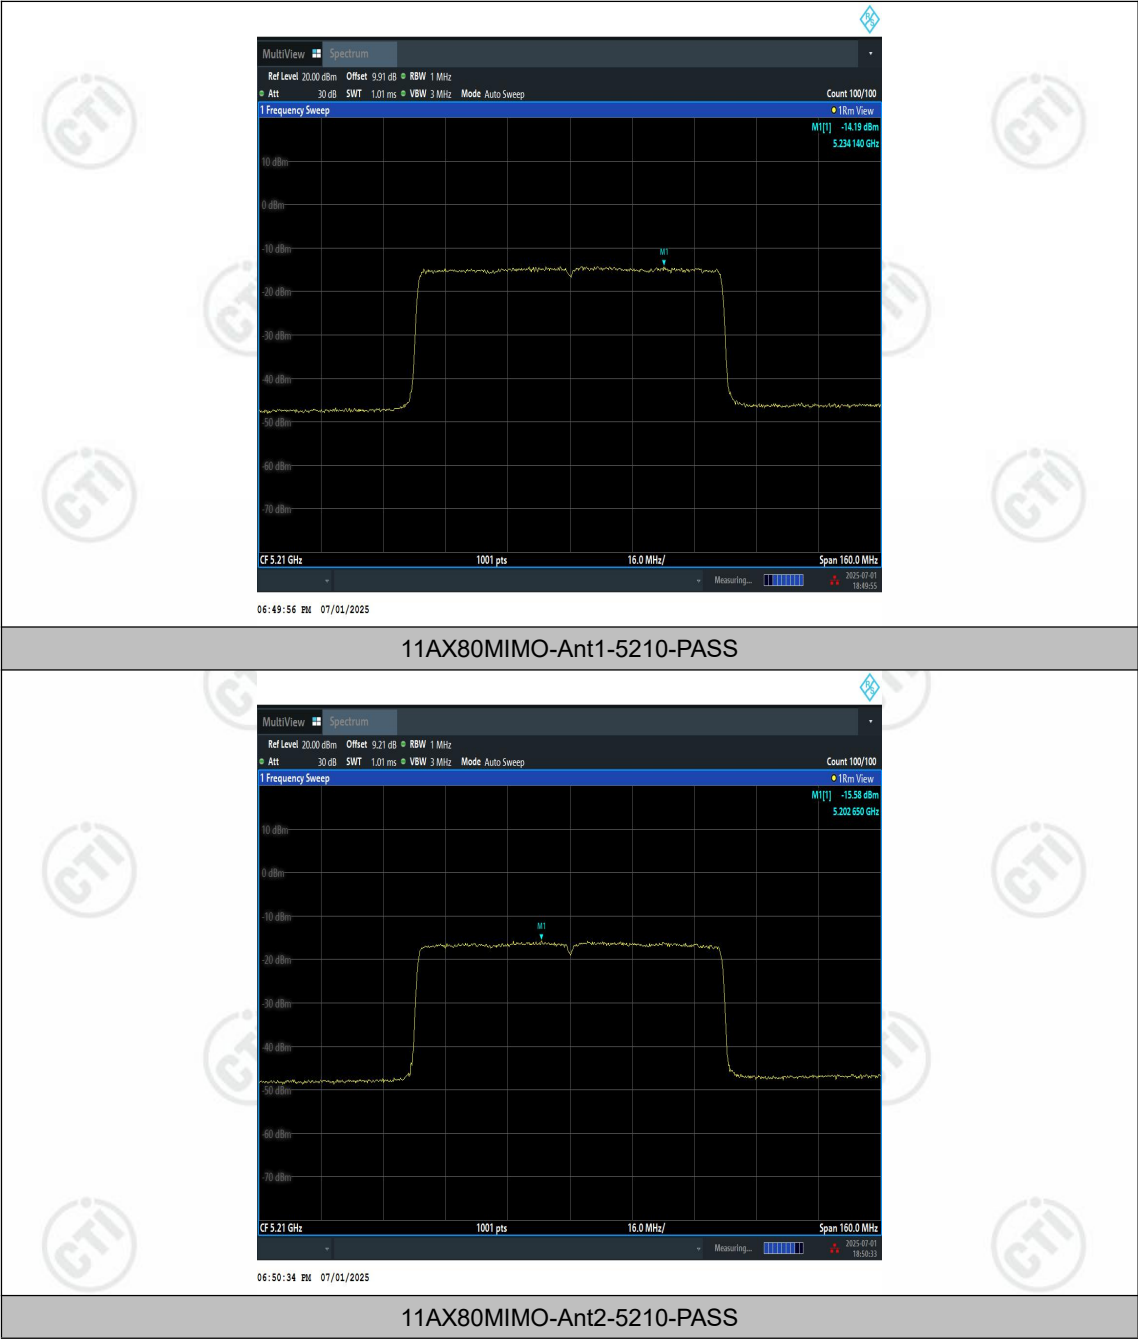

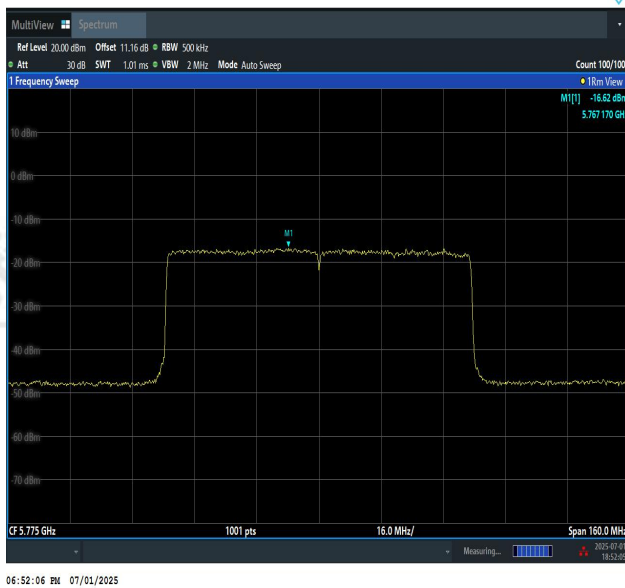

11AX80MIMO-Ant1-5775-PASS

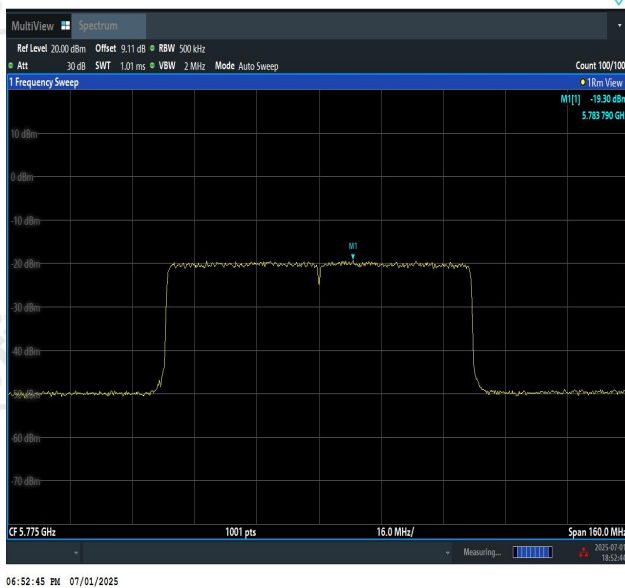

11AX80MIMO-Ant2-5775-PASS

## Frequency Stability

| Condition | Mode | Frequency<br>(MHz) | Antenna | Measured Frequency<br>(MHz) | Frequency Error<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
|-----------|------|--------------------|---------|-----------------------------|-------------------------|--------------------|----------------|---------|
| 20C 102V  | 11A  | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 20C 120V  | 11A  | 5180               | Ant1    | 5180.02                     | 20000                   | 3.86               | 25             | Pass    |
| 20C 138V  | 11A  | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| -20C 120V | 11A  | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| -10C 120V | 11A  | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 0C 120V   | 11A  | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 10C 120V  | 11A  | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 30C 120V  | 11A  | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 40C 120V  | 11A  | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 50C 120V  | 11A  | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 20C 102V  | 11A  | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 20C 120V  | 11A  | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 20C 138V  | 11A  | 5200               | Ant1    | 5200                        | 0                       | 0                  | 25             | Pass    |
| -20C 120V | 11A  | 5200               | Ant1    | 5200                        | 0                       | 0                  | 25             | Pass    |
| -10C 120V | 11A  | 5200               | Ant1    | 5199.98                     | -20000                  | -3.85              | 25             | Pass    |
| 0C 120V   | 11A  | 5200               | Ant1    | 5199.98                     | -20000                  | -3.85              | 25             | Pass    |
| 10C 120V  | 11A  | 5200               | Ant1    | 5200                        | 0                       | 0                  | 25             | Pass    |
| 30C 120V  | 11A  | 5200               | Ant1    | 5199.98                     | -20000                  | -3.85              | 25             | Pass    |
| 40C 120V  | 11A  | 5200               | Ant1    | 5199.98                     | -20000                  | -3.85              | 25             | Pass    |
| 50C 120V  | 11A  | 5200               | Ant1    | 5200                        | 0                       | 0                  | 25             | Pass    |
| 20C 102V  | 11A  | 5240               | Ant1    | 5240.02                     | 20000                   | 3.82               | 25             | Pass    |
| 20C 120V  | 11A  | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 20C 138V  | 11A  | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| -20C 120V | 11A  | 5240               | Ant1    | 5240.02                     | 20000                   | 3.82               | 25             | Pass    |
| -10C 120V | 11A  | 5240               | Ant1    | 5240.02                     | 20000                   | 3.82               | 25             | Pass    |
| 0C 120V   | 11A  | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| 10C 120V  | 11A  | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 30C 120V  | 11A  | 5240               | Ant1    | 5240                        | 0                       | 0                  | 25             | Pass    |
| 40C 120V  | 11A  | 5240               | Ant1    | 5240                        | 0                       | 0                  | 25             | Pass    |
| 50C 120V  | 11A  | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 20C 102V  | 11A  | 5745               | Ant1    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |
| 20C 120V  | 11A  | 5745               | Ant1    | 5745                        | 0                       | 0                  | 25             | Pass    |
| 20C 138V  | 11A  | 5745               | Ant1    | 5745                        | 0                       | 0                  | 25             | Pass    |
| -20C 120V | 11A  | 5745               | Ant1    | 5745                        | 0                       | 0                  | 25             | Pass    |
| -10C 120V | 11A  | 5745               | Ant1    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |
| 0C 120V   | 11A  | 5745               | Ant1    | 5745                        | 0                       | 0                  | 25             | Pass    |
| 10C 120V  | 11A  | 5745               | Ant1    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |

|           |     |      |      |         |        |       |    |      |
|-----------|-----|------|------|---------|--------|-------|----|------|
| 30C 120V  | 11A | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 40C 120V  | 11A | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 50C 120V  | 11A | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 20C 102V  | 11A | 5785 | Ant1 | 5784.98 | -20000 | -3.46 | 25 | Pass |
| 20C 120V  | 11A | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |
| 20C 138V  | 11A | 5785 | Ant1 | 5785.02 | 20000  | 3.46  | 25 | Pass |
| -20C 120V | 11A | 5785 | Ant1 | 5784.98 | -20000 | -3.46 | 25 | Pass |
| -10C 120V | 11A | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11A | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |
| 10C 120V  | 11A | 5785 | Ant1 | 5784.98 | -20000 | -3.46 | 25 | Pass |
| 30C 120V  | 11A | 5785 | Ant1 | 5784.98 | -20000 | -3.46 | 25 | Pass |
| 40C 120V  | 11A | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |
| 50C 120V  | 11A | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11A | 5825 | Ant1 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 20C 120V  | 11A | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 20C 138V  | 11A | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| -20C 120V | 11A | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| -10C 120V | 11A | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11A | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 10C 120V  | 11A | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 30C 120V  | 11A | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11A | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 50C 120V  | 11A | 5825 | Ant1 | 5825    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11A | 5180 | Ant2 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 20C 120V  | 11A | 5180 | Ant2 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 20C 138V  | 11A | 5180 | Ant2 | 5180    | 0      | 0     | 25 | Pass |
| -20C 120V | 11A | 5180 | Ant2 | 5180    | 0      | 0     | 25 | Pass |
| -10C 120V | 11A | 5180 | Ant2 | 5180    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11A | 5180 | Ant2 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 10C 120V  | 11A | 5180 | Ant2 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 30C 120V  | 11A | 5180 | Ant2 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 40C 120V  | 11A | 5180 | Ant2 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 50C 120V  | 11A | 5180 | Ant2 | 5180    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11A | 5200 | Ant2 | 5200.06 | 60000  | 11.54 | 25 | Pass |
| 20C 120V  | 11A | 5200 | Ant2 | 5200.02 | 20000  | 3.85  | 25 | Pass |
| 20C 138V  | 11A | 5200 | Ant2 | 5200.02 | 20000  | 3.85  | 25 | Pass |
| -20C 120V | 11A | 5200 | Ant2 | 5200.04 | 40000  | 7.69  | 25 | Pass |
| -10C 120V | 11A | 5200 | Ant2 | 5200.02 | 20000  | 3.85  | 25 | Pass |
| 0C 120V   | 11A | 5200 | Ant2 | 5200.04 | 40000  | 7.69  | 25 | Pass |
| 10C 120V  | 11A | 5200 | Ant2 | 5200.04 | 40000  | 7.69  | 25 | Pass |
| 30C 120V  | 11A | 5200 | Ant2 | 5200    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11A | 5200 | Ant2 | 5200.04 | 40000  | 7.69  | 25 | Pass |

|           |            |      |      |         |        |       |    |      |
|-----------|------------|------|------|---------|--------|-------|----|------|
| 50C 120V  | 11A        | 5200 | Ant2 | 5200    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 20C 120V  | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 20C 138V  | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| -20C 120V | 11A        | 5240 | Ant2 | 5240    | 0      | 0     | 25 | Pass |
| -10C 120V | 11A        | 5240 | Ant2 | 5240    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 10C 120V  | 11A        | 5240 | Ant2 | 5240    | 0      | 0     | 25 | Pass |
| 30C 120V  | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 40C 120V  | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 50C 120V  | 11A        | 5240 | Ant2 | 5240.02 | 20000  | 3.82  | 25 | Pass |
| 20C 102V  | 11A        | 5745 | Ant2 | 5745    | 0      | 0     | 25 | Pass |
| 20C 120V  | 11A        | 5745 | Ant2 | 5745    | 0      | 0     | 25 | Pass |
| 20C 138V  | 11A        | 5745 | Ant2 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| -20C 120V | 11A        | 5745 | Ant2 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| -10C 120V | 11A        | 5745 | Ant2 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 0C 120V   | 11A        | 5745 | Ant2 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 10C 120V  | 11A        | 5745 | Ant2 | 5745    | 0      | 0     | 25 | Pass |
| 30C 120V  | 11A        | 5745 | Ant2 | 5745    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11A        | 5745 | Ant2 | 5745    | 0      | 0     | 25 | Pass |
| 50C 120V  | 11A        | 5745 | Ant2 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 20C 102V  | 11A        | 5785 | Ant2 | 5785.02 | 20000  | 3.46  | 25 | Pass |
| 20C 120V  | 11A        | 5785 | Ant2 | 5785.02 | 20000  | 3.46  | 25 | Pass |
| 20C 138V  | 11A        | 5785 | Ant2 | 5785.02 | 20000  | 3.46  | 25 | Pass |
| -20C 120V | 11A        | 5785 | Ant2 | 5785    | 0      | 0     | 25 | Pass |
| -10C 120V | 11A        | 5785 | Ant2 | 5785.04 | 40000  | 6.91  | 25 | Pass |
| 0C 120V   | 11A        | 5785 | Ant2 | 5785    | 0      | 0     | 25 | Pass |
| 10C 120V  | 11A        | 5785 | Ant2 | 5785.02 | 20000  | 3.46  | 25 | Pass |
| 30C 120V  | 11A        | 5785 | Ant2 | 5785    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11A        | 5785 | Ant2 | 5784.98 | -20000 | -3.46 | 25 | Pass |
| 50C 120V  | 11A        | 5785 | Ant2 | 5785    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11A        | 5825 | Ant2 | 5825    | 0      | 0     | 25 | Pass |
| 20C 120V  | 11A        | 5825 | Ant2 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 20C 138V  | 11A        | 5825 | Ant2 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| -20C 120V | 11A        | 5825 | Ant2 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| -10C 120V | 11A        | 5825 | Ant2 | 5825    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11A        | 5825 | Ant2 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 10C 120V  | 11A        | 5825 | Ant2 | 5825.04 | 40000  | 6.87  | 25 | Pass |
| 30C 120V  | 11A        | 5825 | Ant2 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 40C 120V  | 11A        | 5825 | Ant2 | 5825    | 0      | 0     | 25 | Pass |
| 50C 120V  | 11A        | 5825 | Ant2 | 5825.02 | 20000  | 3.43  | 25 | Pass |
| 20C 102V  | 11AC20SISO | 5180 | Ant1 | 5179.96 | -40000 | -7.72 | 25 | Pass |

|           |            |      |      |         |        |       |    |      |
|-----------|------------|------|------|---------|--------|-------|----|------|
| 20C 120V  | 11AC20SISO | 5180 | Ant1 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 20C 138V  | 11AC20SISO | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| -20C 120V | 11AC20SISO | 5180 | Ant1 | 5179.98 | -20000 | -3.86 | 25 | Pass |
| -10C 120V | 11AC20SISO | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11AC20SISO | 5180 | Ant1 | 5179.96 | -40000 | -7.72 | 25 | Pass |
| 10C 120V  | 11AC20SISO | 5180 | Ant1 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 30C 120V  | 11AC20SISO | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11AC20SISO | 5180 | Ant1 | 5180.02 | 20000  | 3.86  | 25 | Pass |
| 50C 120V  | 11AC20SISO | 5180 | Ant1 | 5180    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11AC20SISO | 5200 | Ant1 | 5200    | 0      | 0     | 25 | Pass |
| 20C 120V  | 11AC20SISO | 5200 | Ant1 | 5200.02 | 20000  | 3.85  | 25 | Pass |
| 20C 138V  | 11AC20SISO | 5200 | Ant1 | 5200    | 0      | 0     | 25 | Pass |
| -20C 120V | 11AC20SISO | 5200 | Ant1 | 5200    | 0      | 0     | 25 | Pass |
| -10C 120V | 11AC20SISO | 5200 | Ant1 | 5199.98 | -20000 | -3.85 | 25 | Pass |
| 0C 120V   | 11AC20SISO | 5200 | Ant1 | 5200    | 0      | 0     | 25 | Pass |
| 10C 120V  | 11AC20SISO | 5200 | Ant1 | 5200    | 0      | 0     | 25 | Pass |
| 30C 120V  | 11AC20SISO | 5200 | Ant1 | 5199.98 | -20000 | -3.85 | 25 | Pass |
| 40C 120V  | 11AC20SISO | 5200 | Ant1 | 5199.98 | -20000 | -3.85 | 25 | Pass |
| 50C 120V  | 11AC20SISO | 5200 | Ant1 | 5200    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11AC20SISO | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 20C 120V  | 11AC20SISO | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 20C 138V  | 11AC20SISO | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| -20C 120V | 11AC20SISO | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| -10C 120V | 11AC20SISO | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11AC20SISO | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 10C 120V  | 11AC20SISO | 5240 | Ant1 | 5239.98 | -20000 | -3.82 | 25 | Pass |
| 30C 120V  | 11AC20SISO | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11AC20SISO | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 50C 120V  | 11AC20SISO | 5240 | Ant1 | 5240    | 0      | 0     | 25 | Pass |
| 20C 102V  | 11AC20SISO | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 20C 120V  | 11AC20SISO | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 20C 138V  | 11AC20SISO | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| -20C 120V | 11AC20SISO | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| -10C 120V | 11AC20SISO | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 0C 120V   | 11AC20SISO | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 10C 120V  | 11AC20SISO | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 30C 120V  | 11AC20SISO | 5745 | Ant1 | 5745    | 0      | 0     | 25 | Pass |
| 40C 120V  | 11AC20SISO | 5745 | Ant1 | 5745.02 | 20000  | 3.48  | 25 | Pass |
| 50C 120V  | 11AC20SISO | 5745 | Ant1 | 5744.98 | -20000 | -3.48 | 25 | Pass |
| 20C 102V  | 11AC20SISO | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |
| 20C 120V  | 11AC20SISO | 5785 | Ant1 | 5784.98 | -20000 | -3.46 | 25 | Pass |
| 20C 138V  | 11AC20SISO | 5785 | Ant1 | 5785    | 0      | 0     | 25 | Pass |