





Restrict Band NVNT ac20 5260MHz Ant1 Peak

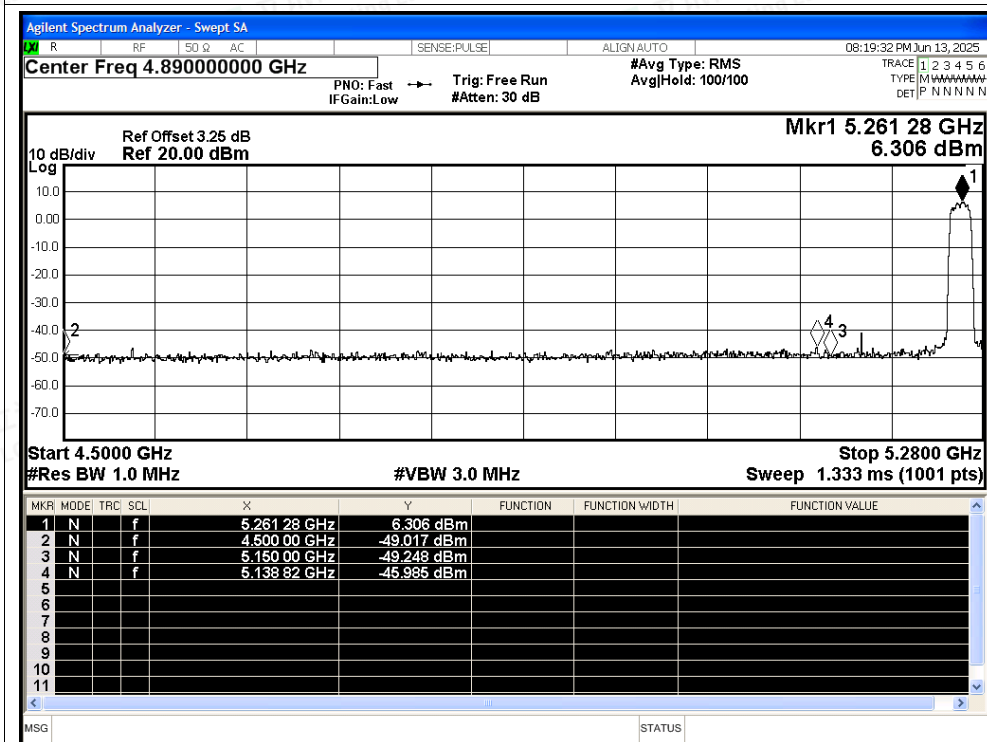

Restrict Band NVNT ac20 5260MHz Ant1 Average

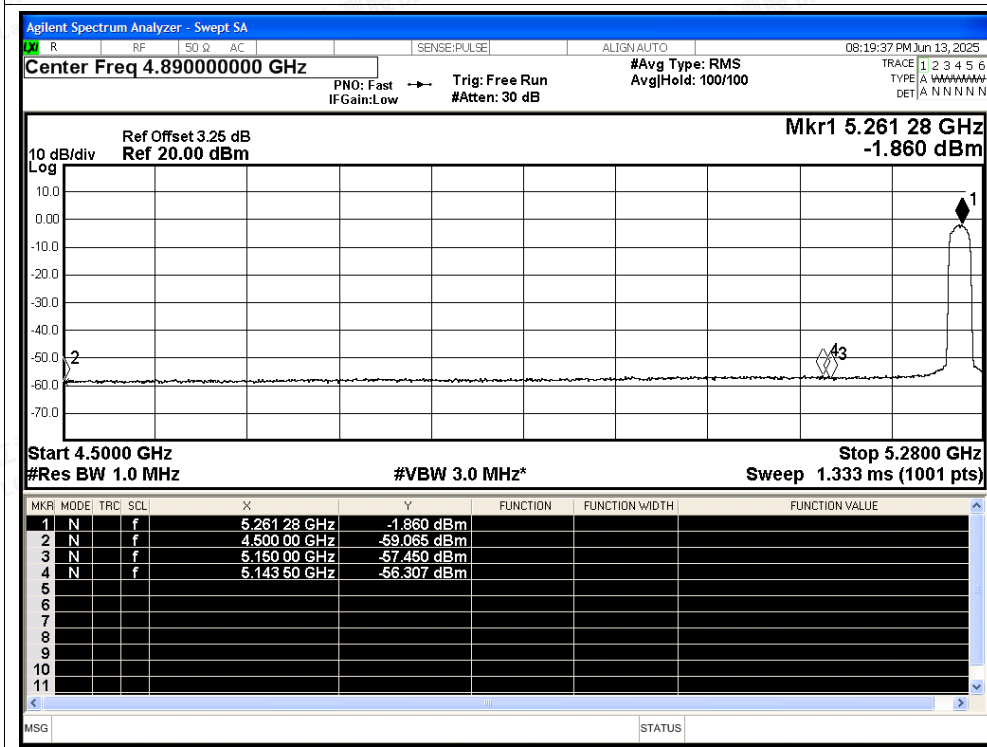

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant1 Peak

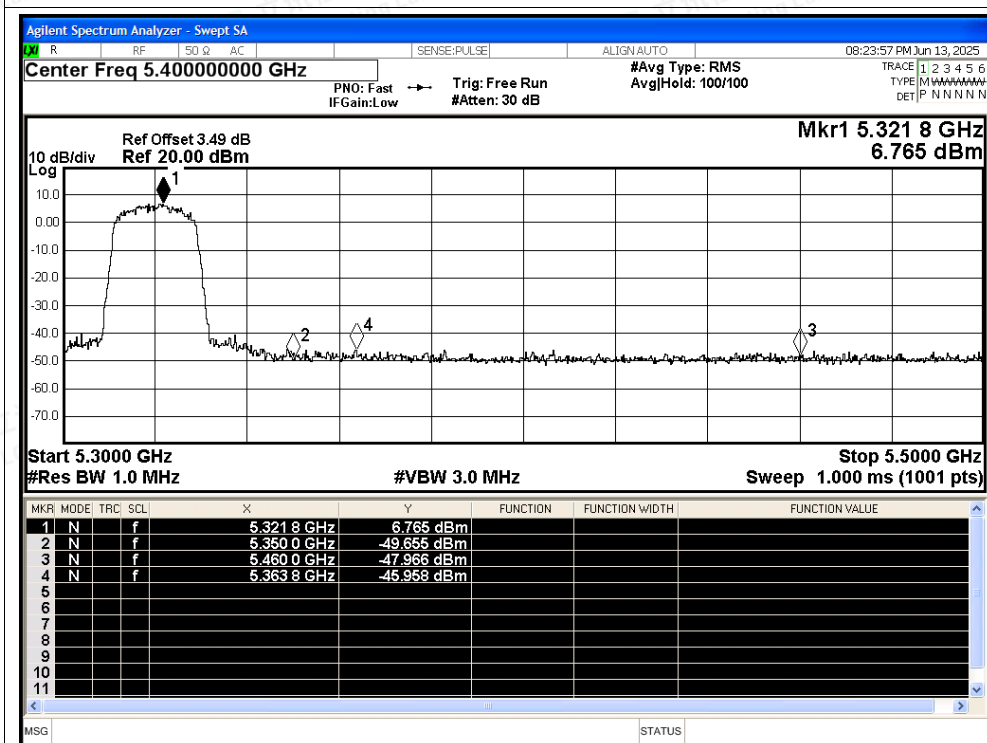

Restrict Band NVNT ac20 5320MHz Ant1 Average

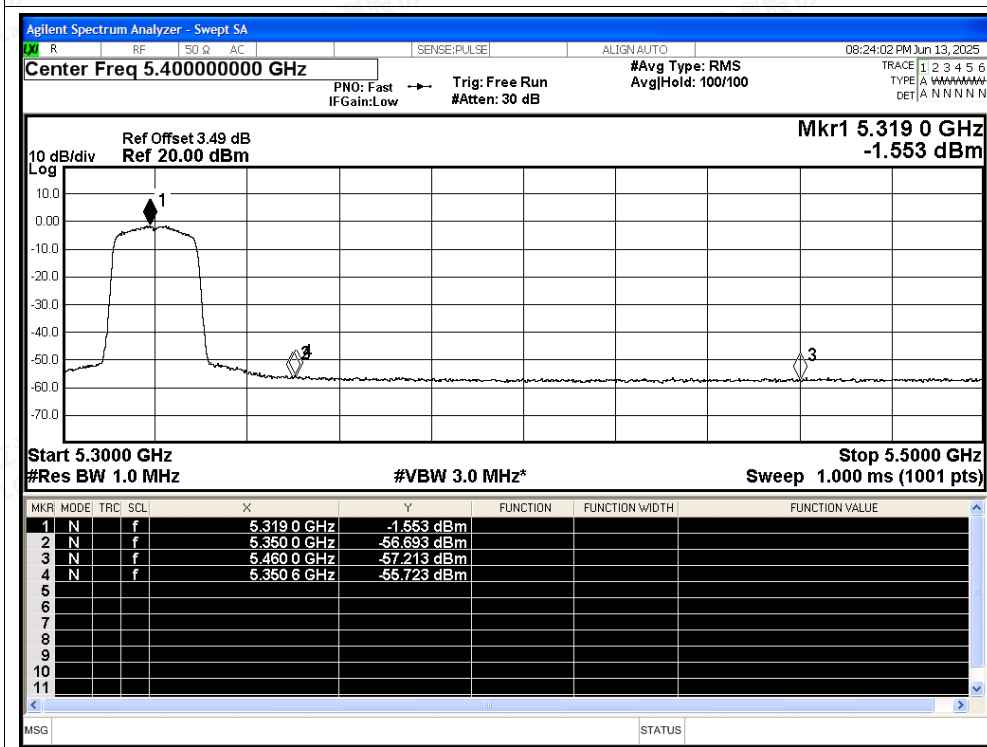

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant1 Peak

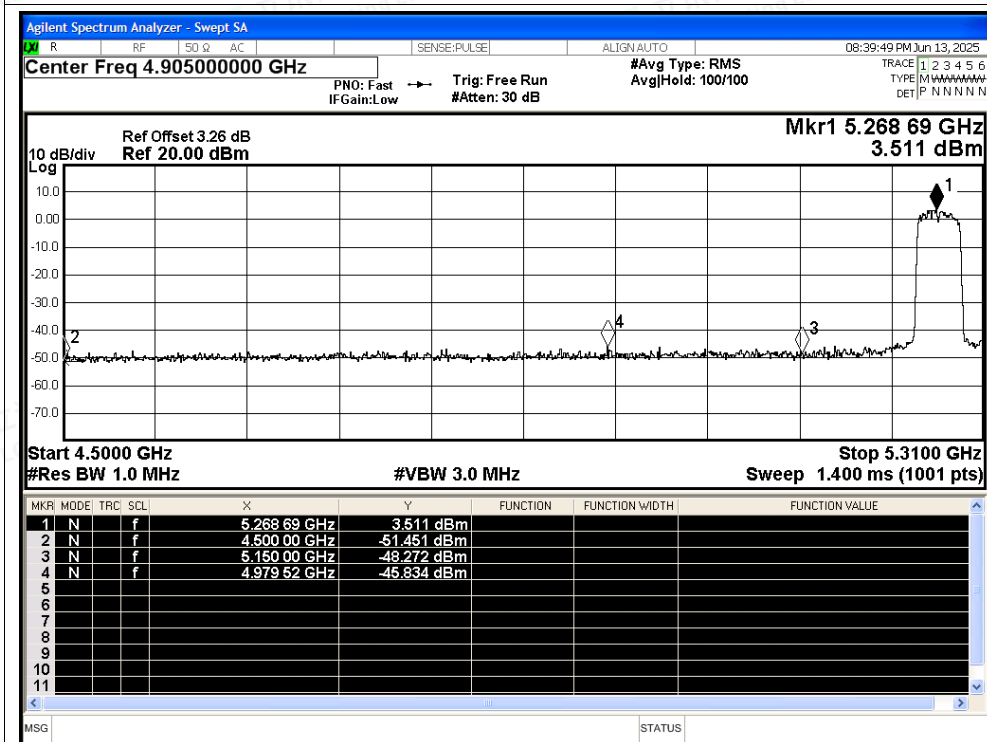

Restrict Band NVNT ac40 5270MHz Ant1 Average

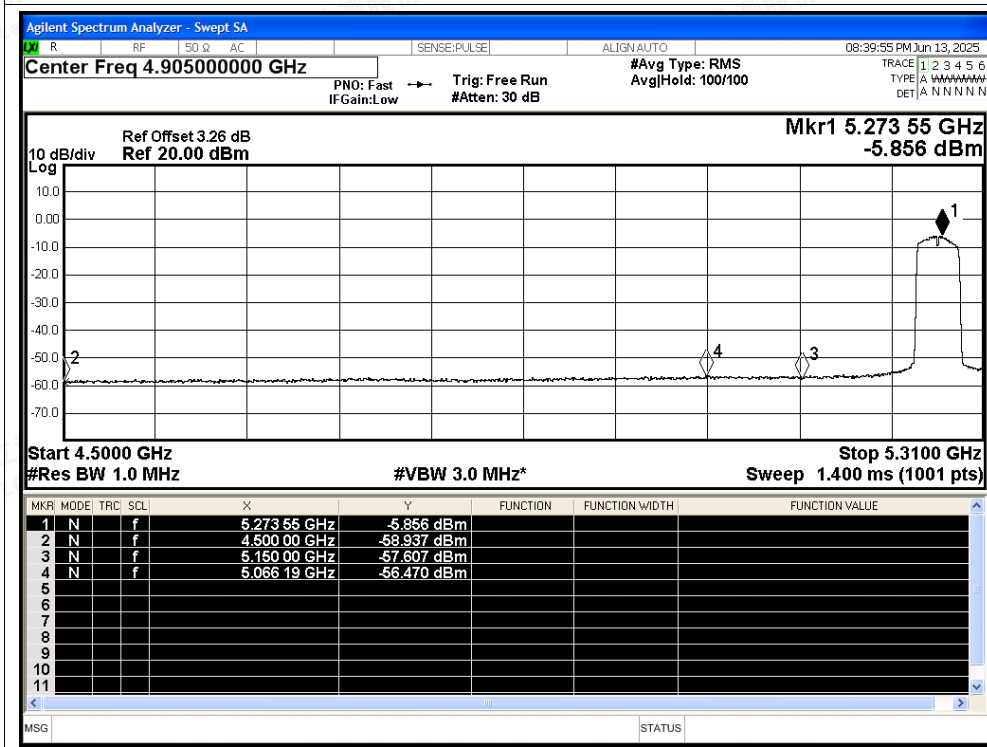

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant1 Peak

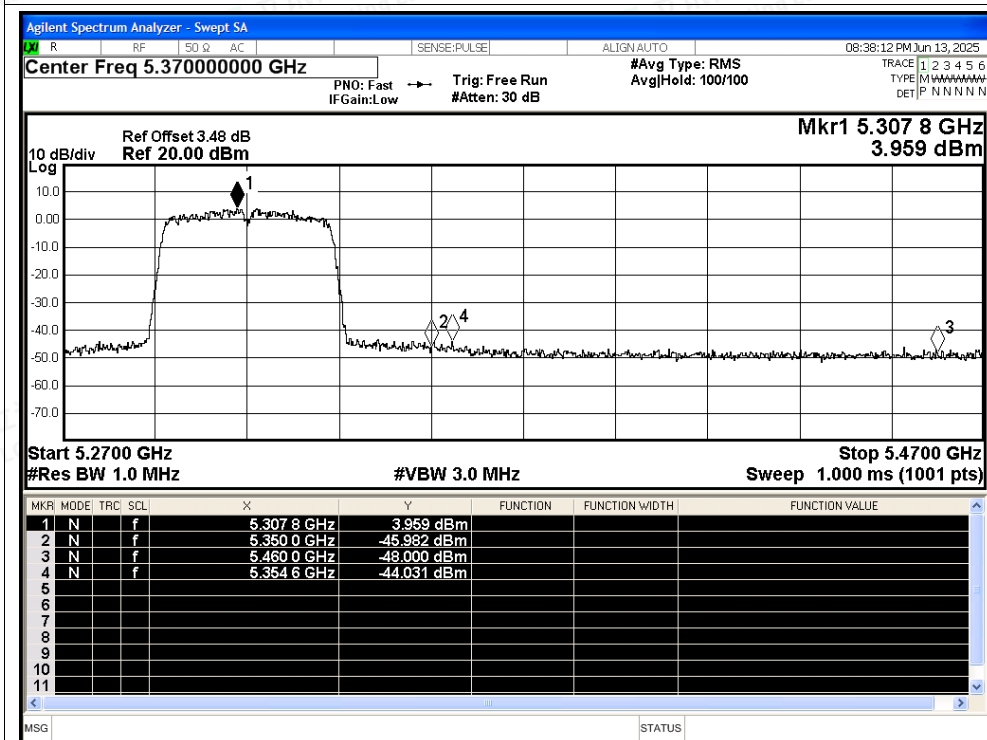

Restrict Band NVNT ac40 5310MHz Ant1 Average

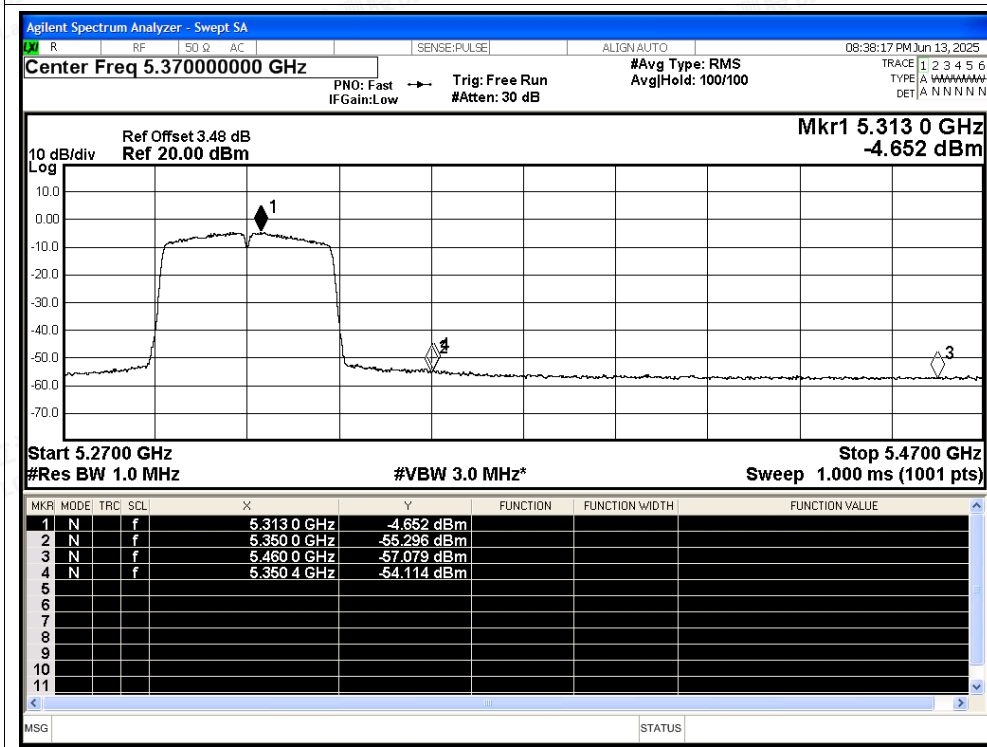

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

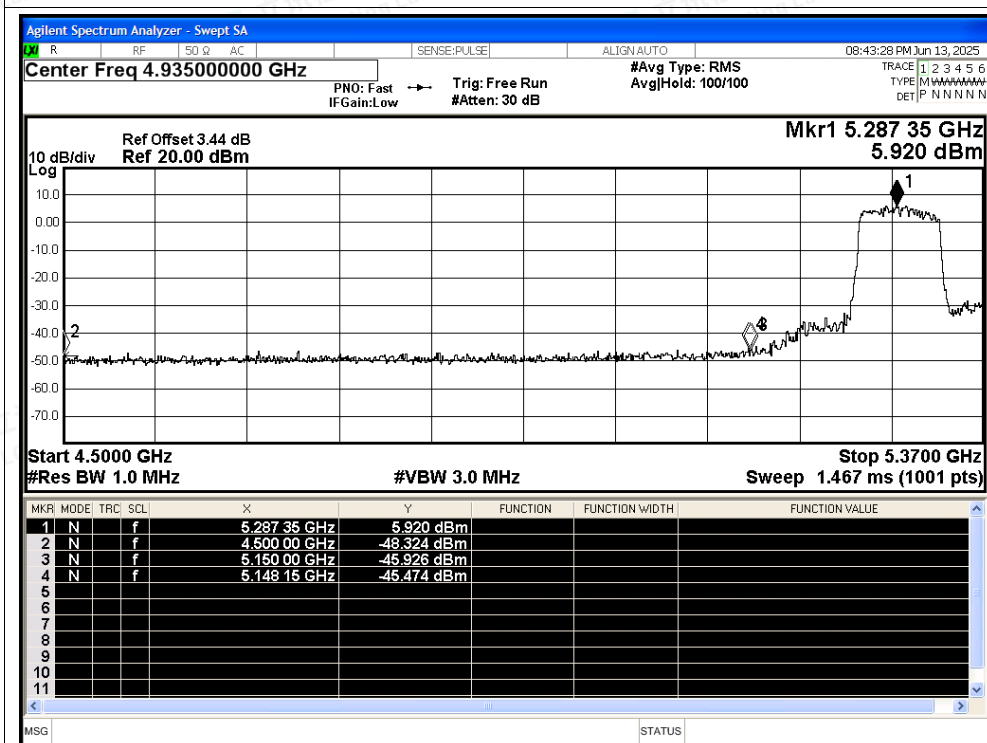


Restrict Band NVNT ac80 5290MHz Ant1 Average

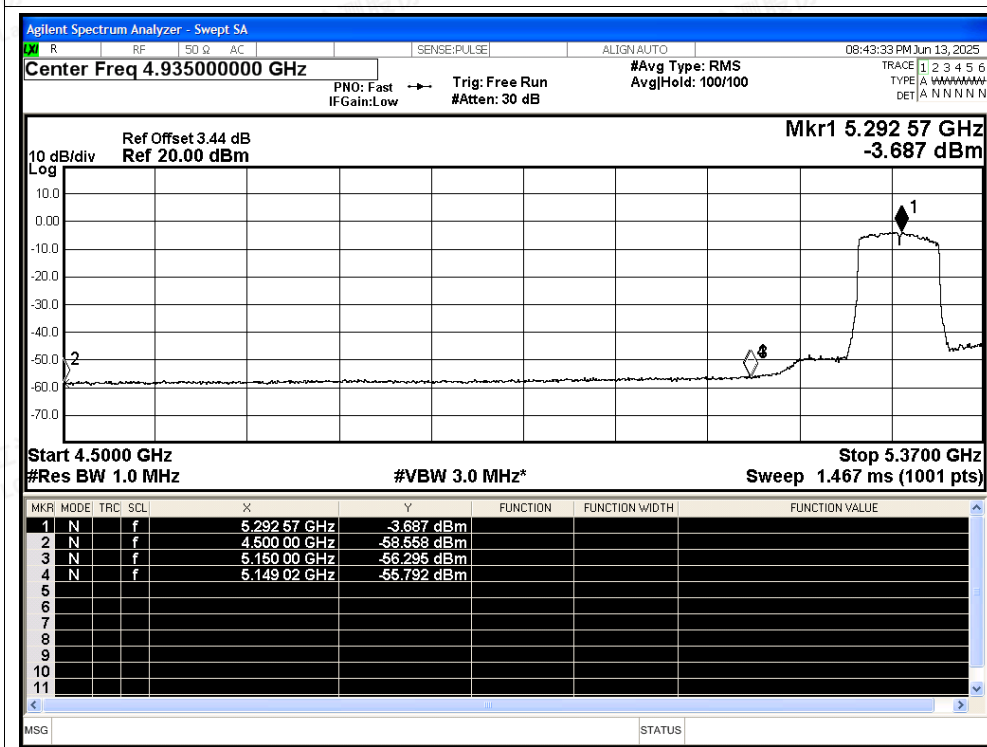




Restrict Band NVNT ac80 5290MHz Ant1 Peak

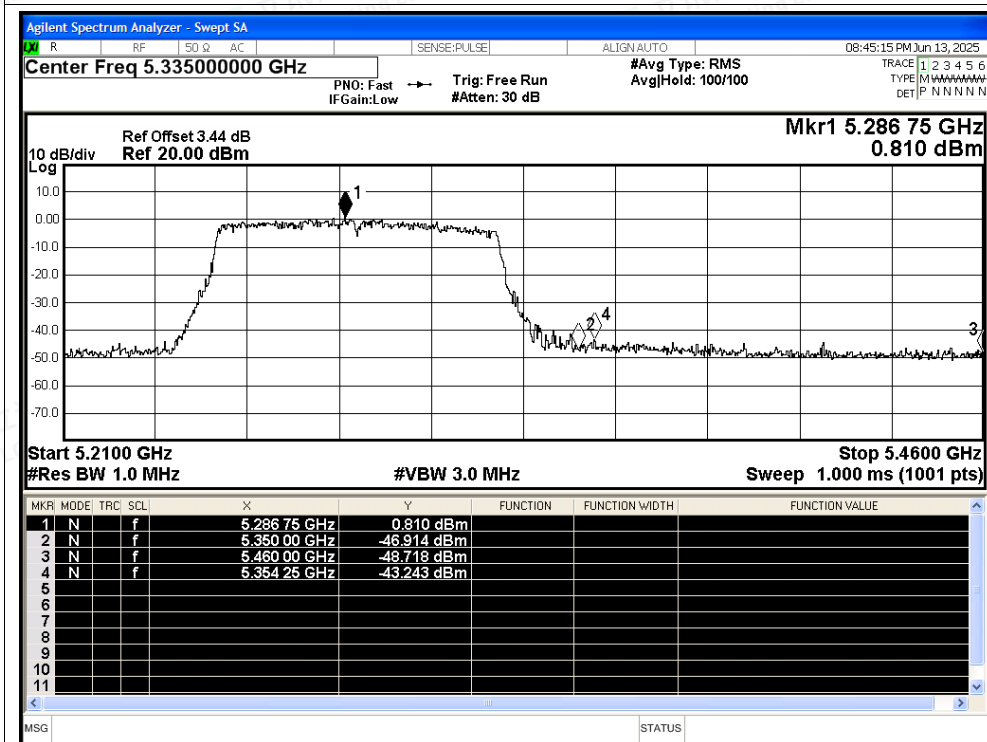

Restrict Band NVNT ac80 5290MHz Ant1 Average

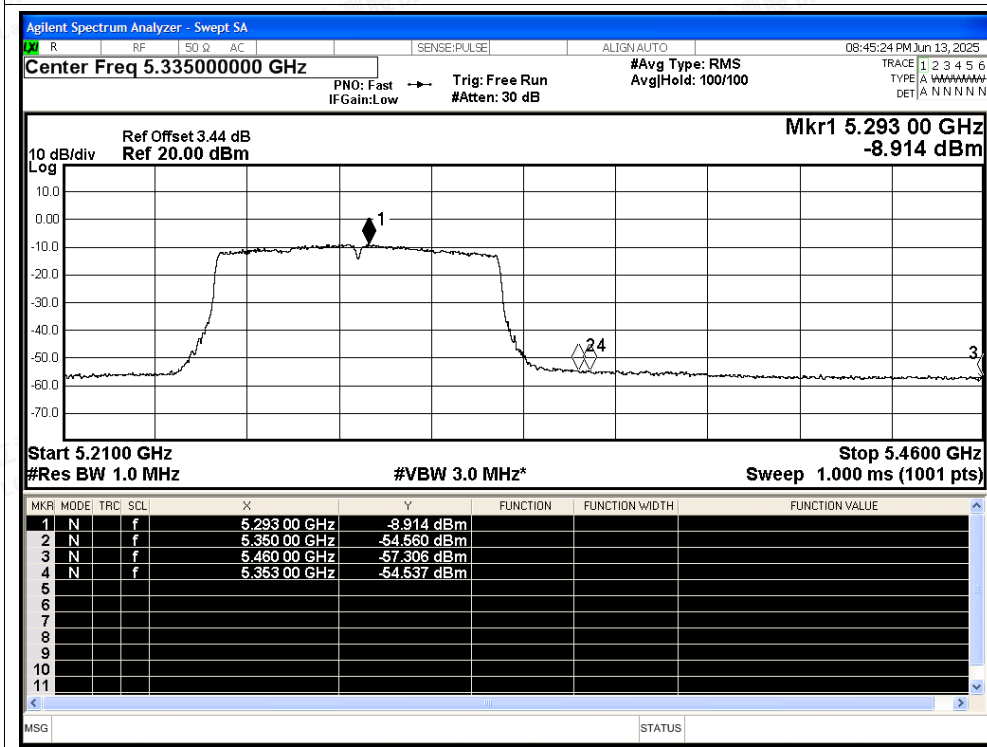

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant1 Peak

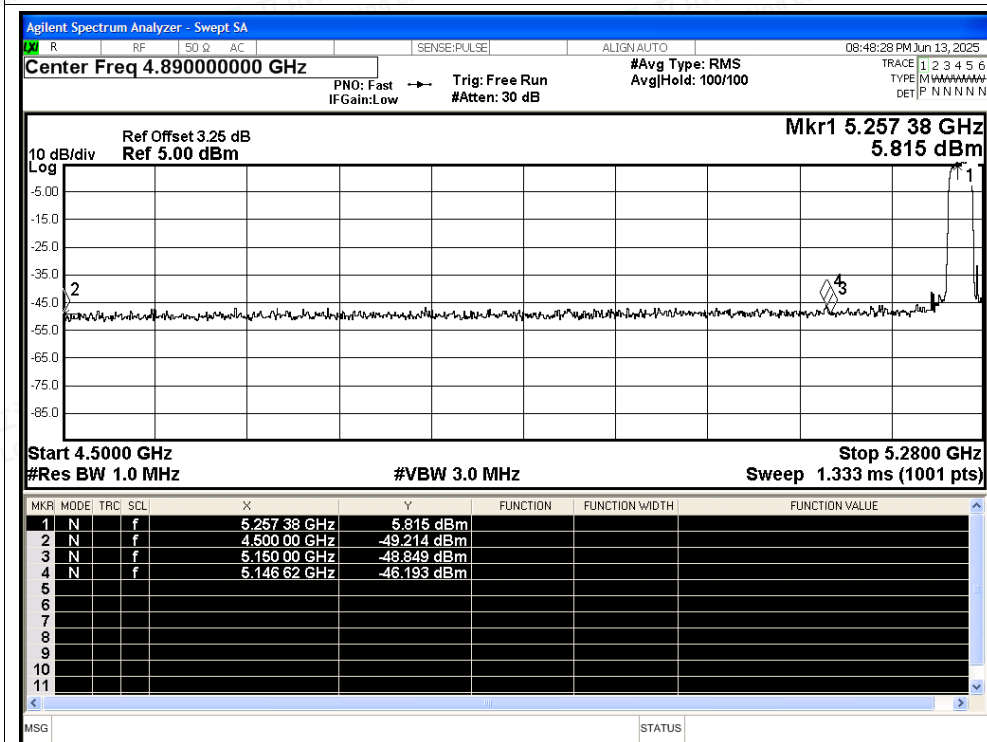

Restrict Band NVNT ax20 5260MHz Ant1 Average

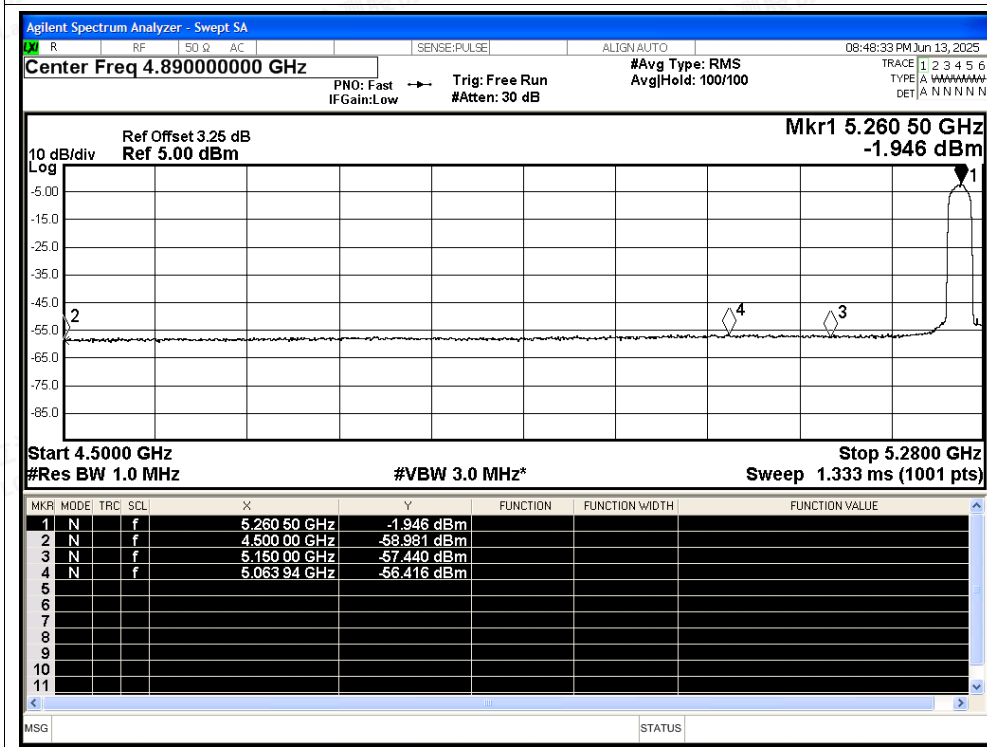

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant1 Peak

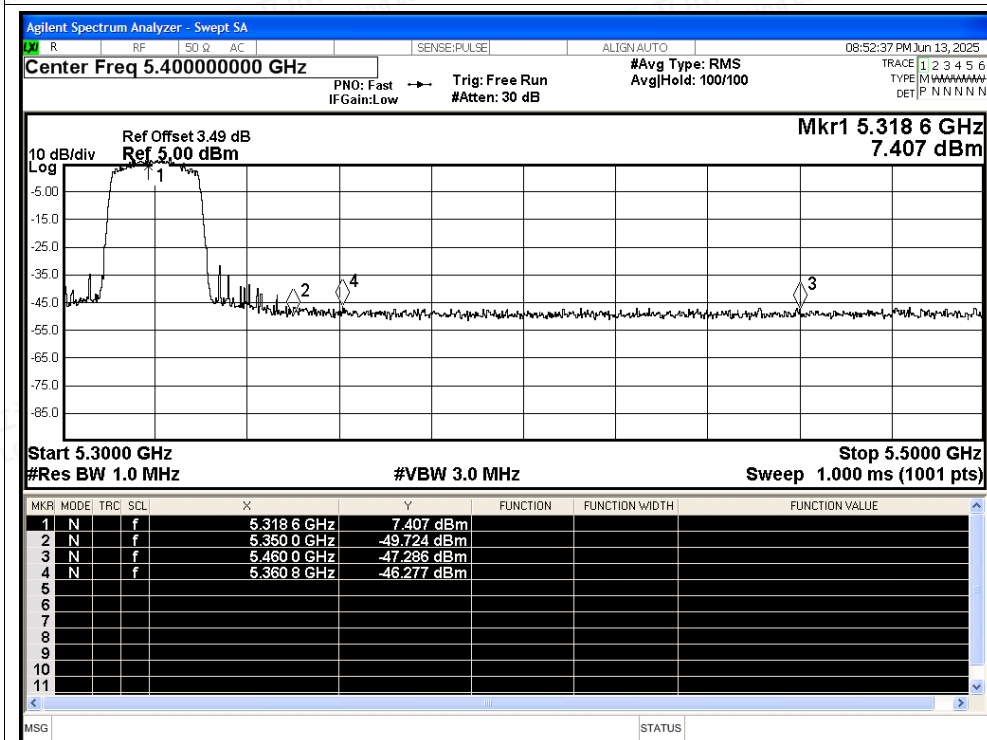

Restrict Band NVNT ax20 5320MHz Ant1 Average

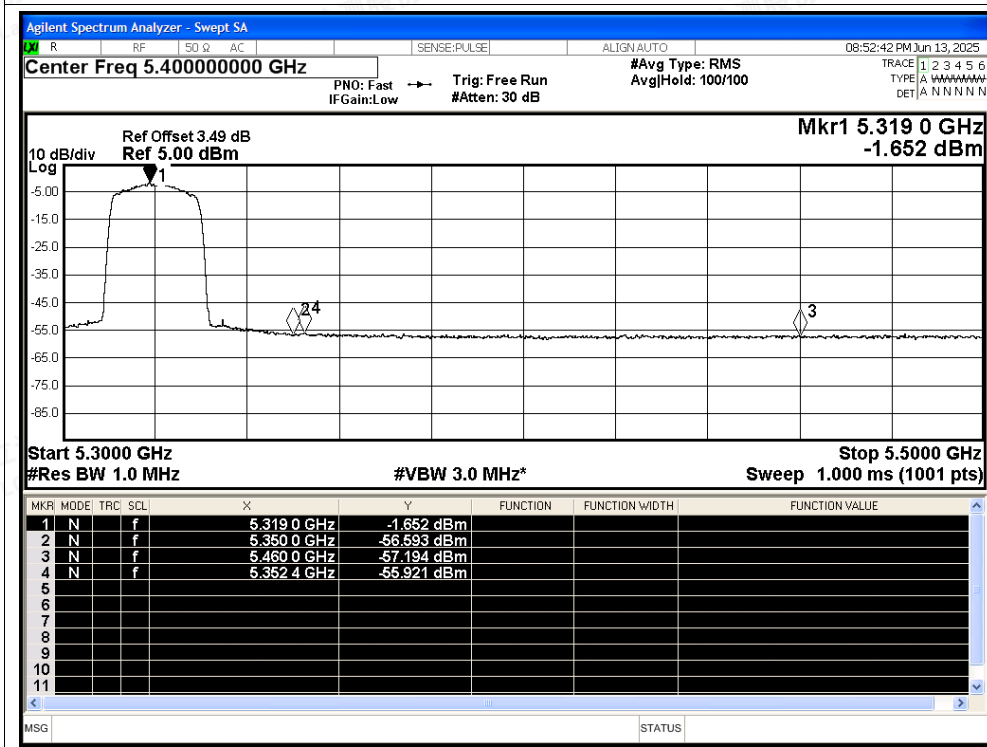

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant1 Peak

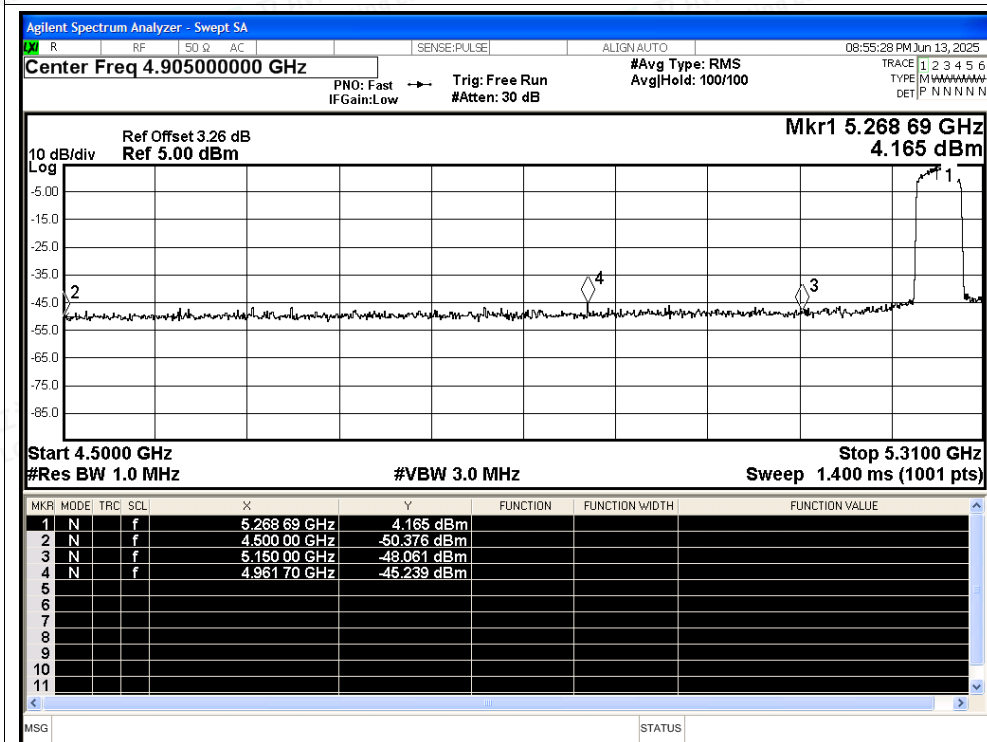

Restrict Band NVNT ax40 5270MHz Ant1 Average

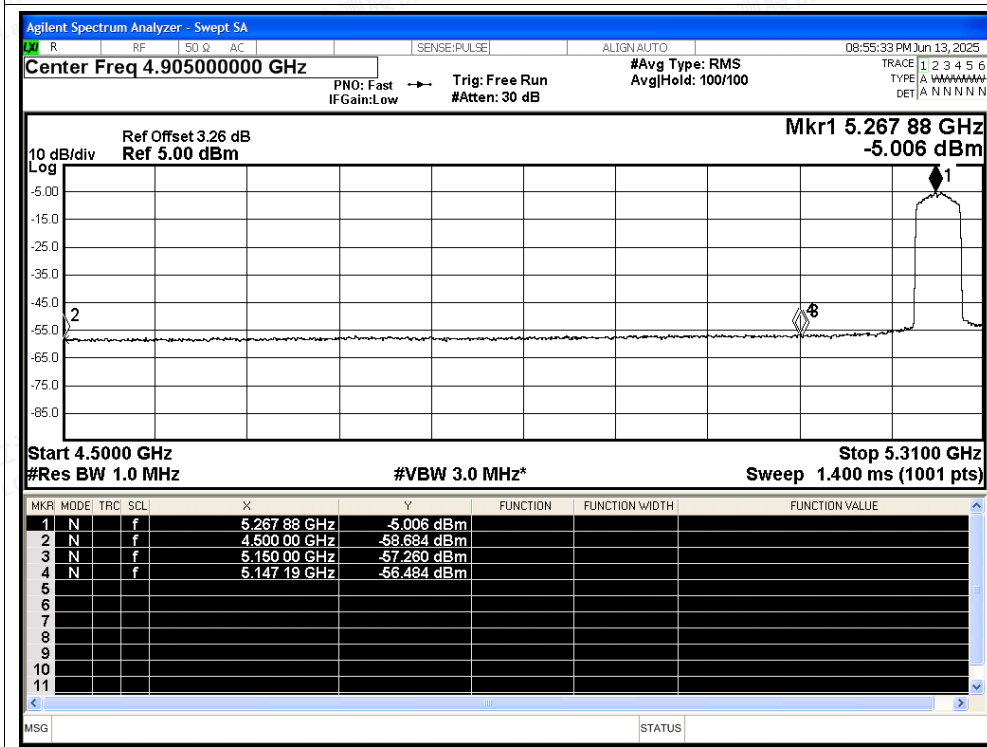

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant1 Peak

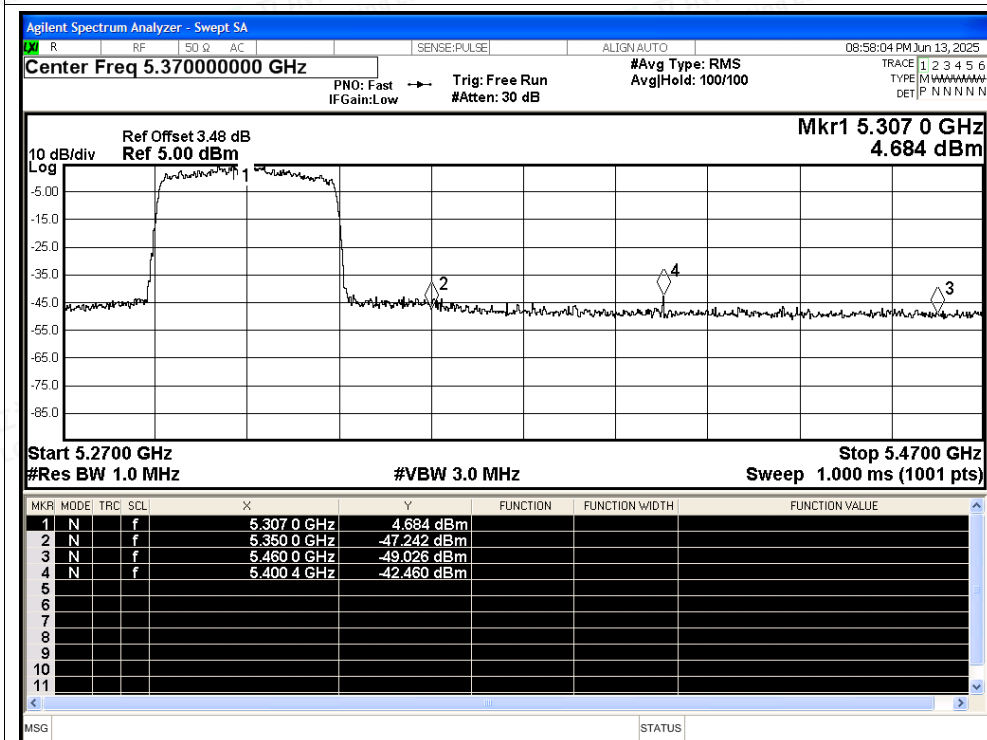

Restrict Band NVNT ax40 5310MHz Ant1 Average

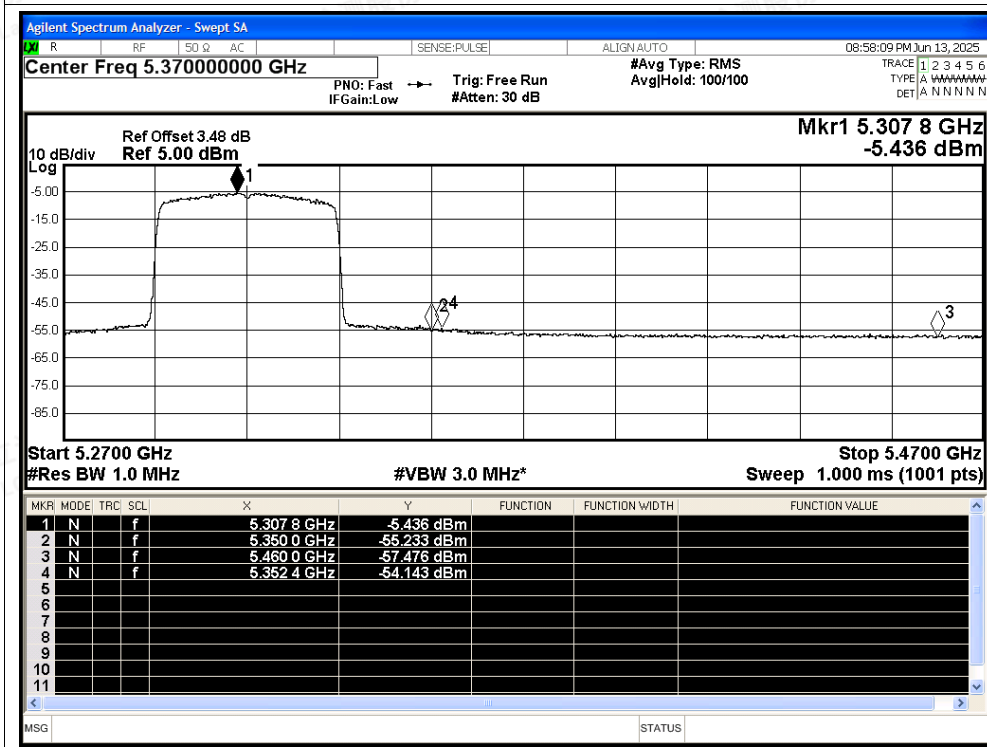

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

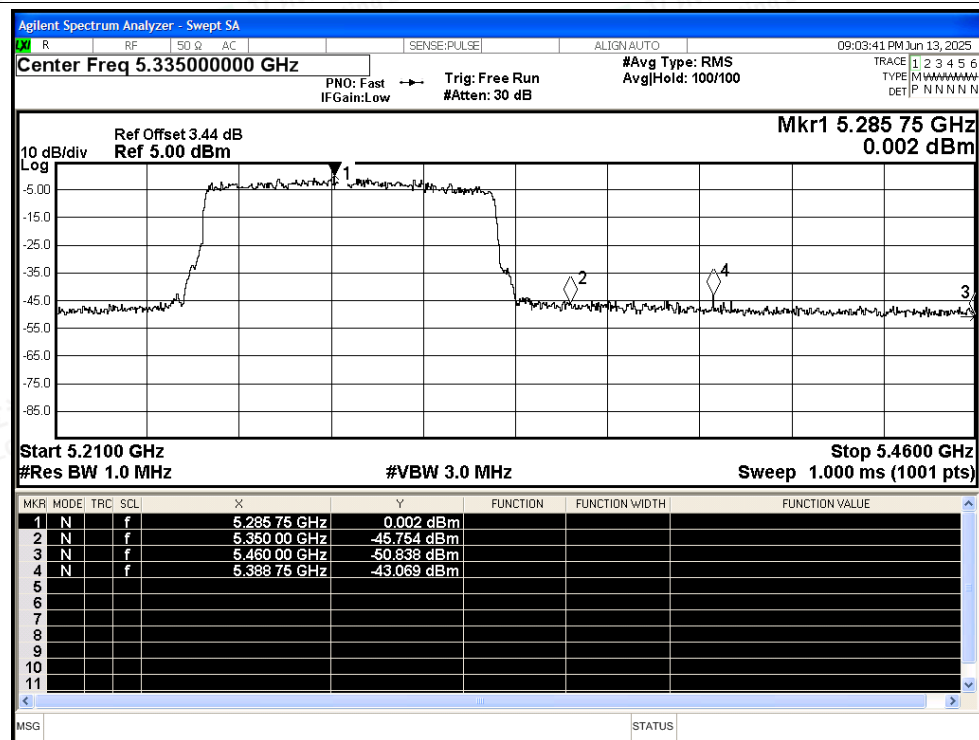

Restrict Band NVNT ax80 5290MHz Ant1 Average

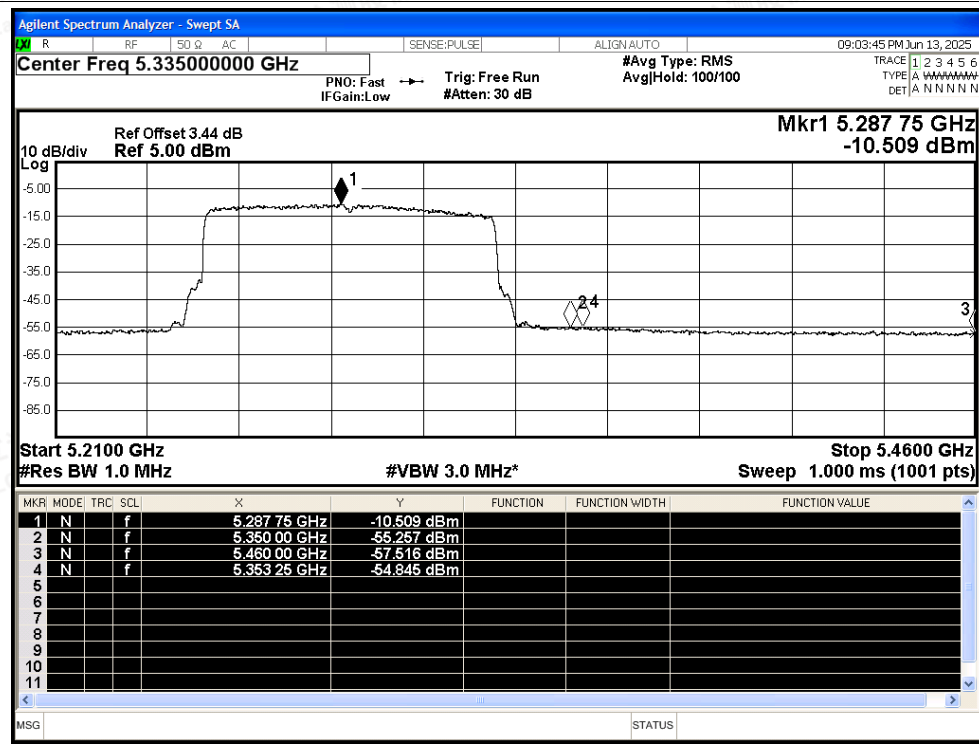

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

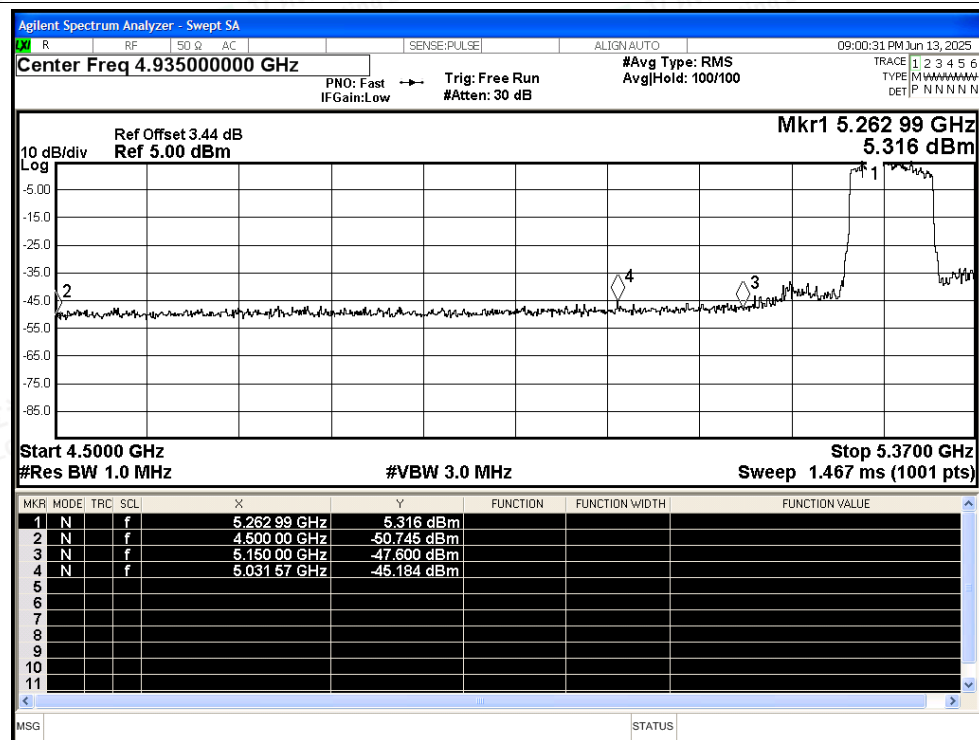

Restrict Band NVNT ax80 5290MHz Ant1 Average

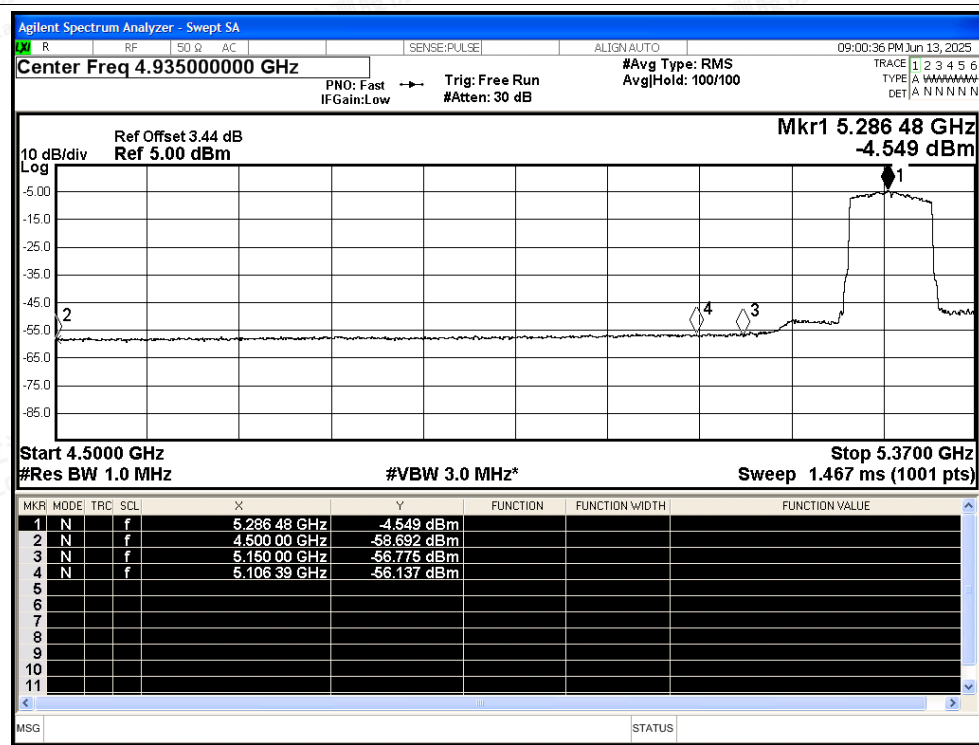

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-49.53	2.00	-	47.70	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-58.57	2.00	0.31	38.97	Average	54	Pass
NVNT	a	5260	Ant2	4787.04	-46.59	2.00	-	50.64	Peak	68.2	Pass
NVNT	a	5260	Ant2	5093.58	-56.43	2.00	0.31	41.11	Average	54	Pass
NVNT	a	5260	Ant2	5150	-50.03	2.00	-	47.20	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-57.09	2.00	0.31	40.45	Average	54	Pass
NVNT	a	5320	Ant2	5350	-46.37	2.00	-	50.86	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-56.35	2.00	0.31	41.19	Average	54	Pass
NVNT	a	5320	Ant2	5354.4	-45.9	2.00	-	51.33	Peak	68.2	Pass
NVNT	a	5320	Ant2	5352	-55.73	2.00	0.31	41.81	Average	54	Pass
NVNT	a	5320	Ant2	5460	-48.39	2.00	-	48.84	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.62	2.00	0.31	39.92	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-51.21	2.00	-	46.02	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-58.93	2.00	0.37	38.67	Average	54	Pass
NVNT	n20	5260	Ant2	5023.38	-46	2.00	-	51.23	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5101.38	-56.47	2.00	0.37	41.13	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-49.43	2.00	-	47.80	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-57.01	2.00	0.37	40.59	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-46.94	2.00	-	50.29	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-56.37	2.00	0.37	41.23	Average	54	Pass
NVNT	n20	5320	Ant2	5356.2	-46.43	2.00	-	50.80	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5352	-55.67	2.00	0.37	41.93	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-49	2.00	-	48.23	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-57.58	2.00	0.37	40.02	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-49.58	2.00	-	47.65	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-58.85	2.00	0.71	39.09	Average	54	Pass
NVNT	n40	5270	Ant2	5096.97	-46.06	2.00	-	51.17	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5110.74	-56.4	2.00	0.71	41.54	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-47.98	2.00	-	49.25	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.02	2.00	0.71	40.92	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-42.4	2.00	-	54.83	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-53.44	2.00	0.71	44.50	Average	54	Pass
NVNT	n40	5310	Ant2	5350.2	-39.27	2.00	-	57.96	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-53.44	2.00	0.71	44.50	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-48.59	2.00	-	48.64	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-56.72	2.00	0.71	41.22	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-50.82	2.00	-	46.41	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-58.35	2.00	0.36	39.24	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	5099.04	-46.14	2.00	-	51.09	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5069.4	-56.45	2.00	0.36	41.14	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-47.89	2.00	-	49.34	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-57.17	2.00	0.36	40.42	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-48.88	2.00	-	48.35	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-56.77	2.00	0.37	40.83	Average	54	Pass
NVNT	ac20	5320	Ant2	5414.6	-46.16	2.00	-	51.07	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5352.6	-55.56	2.00	0.37	42.04	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-50.72	2.00	-	46.51	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.05	2.00	0.37	40.55	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-50.25	2.00	-	46.98	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-59.14	2.00	0.71	38.80	Average	54	Pass
NVNT	ac40	5270	Ant2	5102.64	-45.01	2.00	-	52.22	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5141.52	-56.28	2.00	0.71	41.66	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-47.22	2.00	-	50.01	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-57.06	2.00	0.71	40.88	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-46.18	2.00	-	51.05	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-53.63	2.00	0.71	44.31	Average	54	Pass
NVNT	ac40	5310	Ant2	5354.8	-42.74	2.00	-	54.49	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.8	-53.5	2.00	0.71	44.44	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.24	2.00	-	47.99	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-56.58	2.00	0.71	41.36	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-50.54	2.00	-	46.69	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.81	2.00	0	38.42	Average	54	Pass
NVNT	ac80	5290	Ant2	5149.89	-45.67	2.00	-	51.56	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5142.06	-55.91	2.00	0	41.32	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-45.67	2.00	-	51.56	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-56.82	2.00	0	40.41	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-43.36	2.00	-	53.87	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-52.15	2.00	0	45.08	Average	54	Pass
NVNT	ac80	5290	Ant2	5350.25	-40.8	2.00	-	56.43	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5351.75	-52.11	2.00	0	45.12	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-49.22	2.00	-	48.01	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.21	2.00	0	40.02	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-49.75	2.00	-	47.48	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-58.72	2.00	0.43	38.94	Average	54	Pass
NVNT	ax20	5260	Ant2	5141.16	-46.65	2.00	-	50.58	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5055.36	-56.47	2.00	0.43	41.19	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-49.08	2.00	-	48.15	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-57.85	2.00	0.43	39.81	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-47.64	2.00	-	49.59	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5320	Ant2	5350	-55.46	2.00	0.43	42.20	Average	54	Pass
NVNT	ax20	5320	Ant2	5356.8	-45.32	2.00	-	51.91	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5367.8	-54.56	2.00	0.43	43.10	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-49.5	2.00	-	47.73	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-56.79	2.00	0.43	40.87	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-49.21	2.00	-	48.02	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-58.99	2.00	0.78	39.02	Average	54	Pass
NVNT	ax40	5270	Ant2	5096.97	-46.3	2.00	-	50.93	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5107.5	-56.25	2.00	0.78	41.76	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-48.48	2.00	-	48.75	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-57.25	2.00	0.78	40.76	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-41.88	2.00	-	55.35	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-53.37	2.00	0.78	44.64	Average	54	Pass
NVNT	ax40	5310	Ant2	5426.8	-37.13	2.00	-	60.10	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350.2	-52.81	2.00	0.78	45.20	Average	54	Pass
NVNT	ax40	5310	Ant2	5460	-48.57	2.00	-	48.66	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-57.55	2.00	0.78	40.46	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-44.69	2.00	-	52.54	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-54.91	2.00	1.35	43.67	Average	54	Pass
NVNT	ax80	5290	Ant2	5351.5	-43.57	2.00	-	53.66	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5355	-54.07	2.00	1.35	44.51	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-48.73	2.00	-	48.50	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-56.99	2.00	1.35	41.59	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-51.02	2.00	-	46.21	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.21	2.00	1.35	40.37	Average	54	Pass
NVNT	ax80	5290	Ant2	5142.93	-45.98	2.00	-	51.25	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5149.02	-56.39	2.00	1.35	42.19	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-47.83	2.00	-	49.40	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-56.69	2.00	1.35	41.89	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

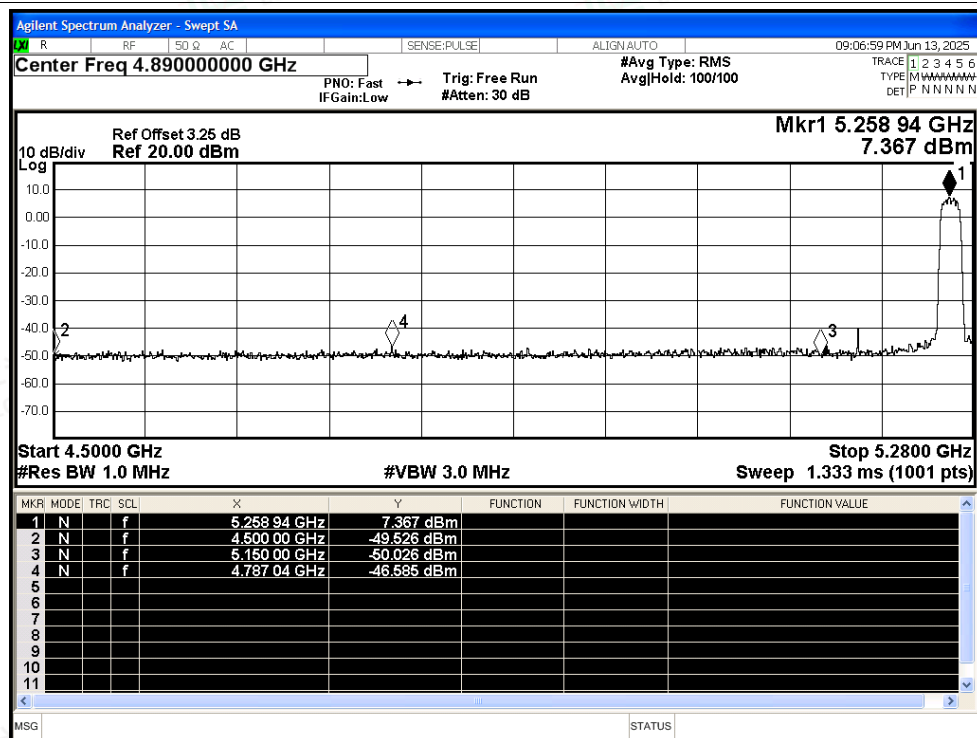

Restrict Band NVNT a 5260MHz Ant2 Average

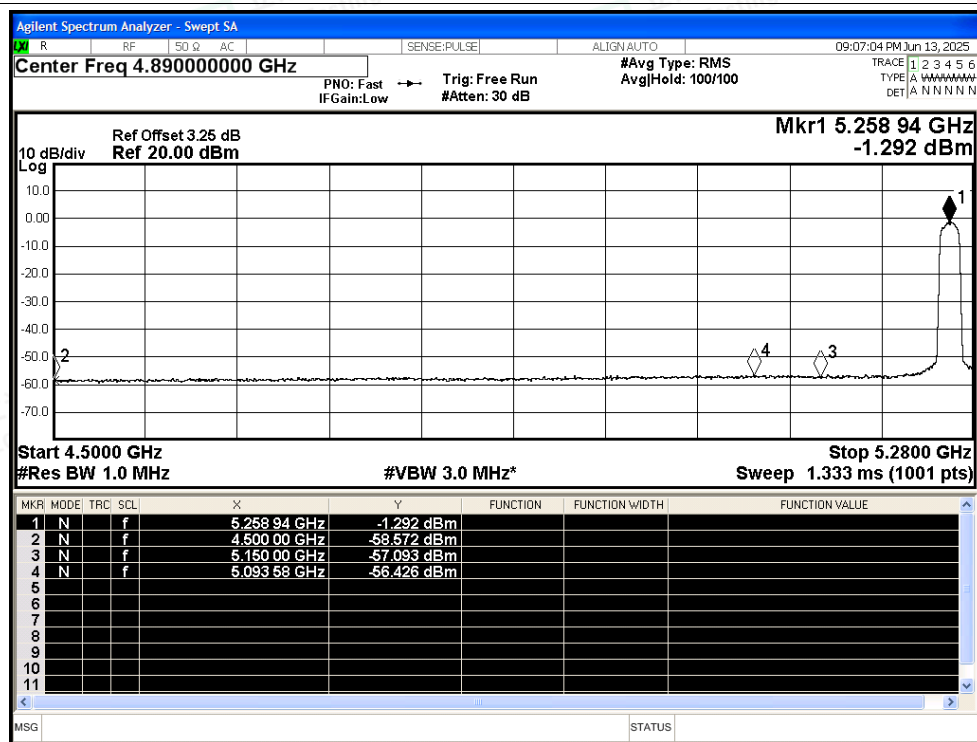

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant2 Peak

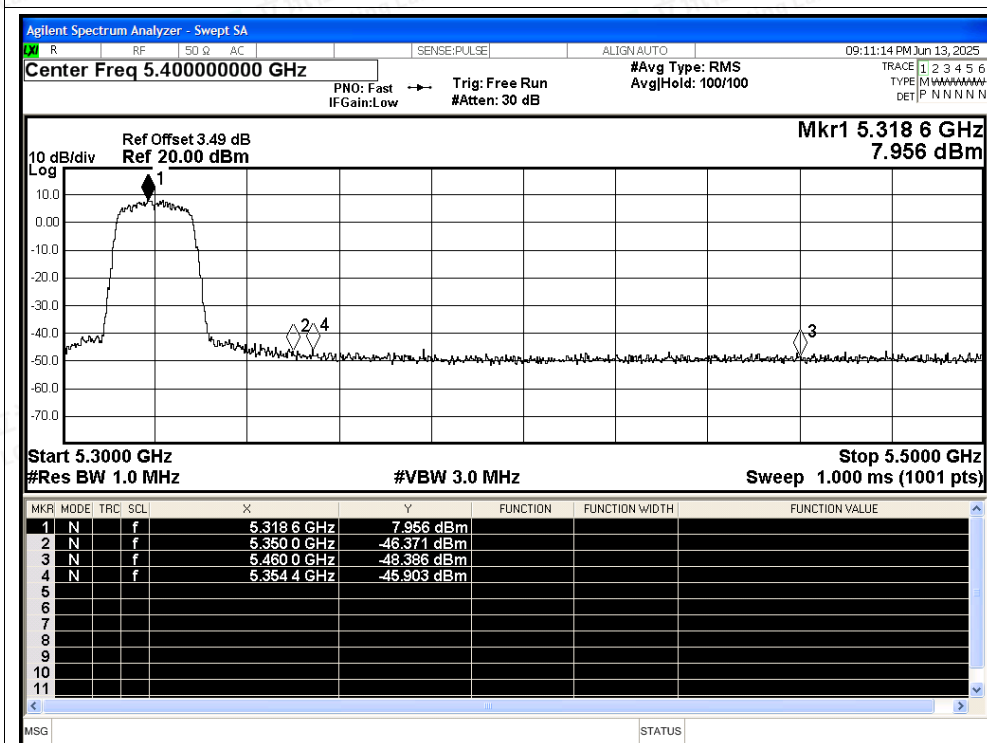

Restrict Band NVNT a 5320MHz Ant2 Average

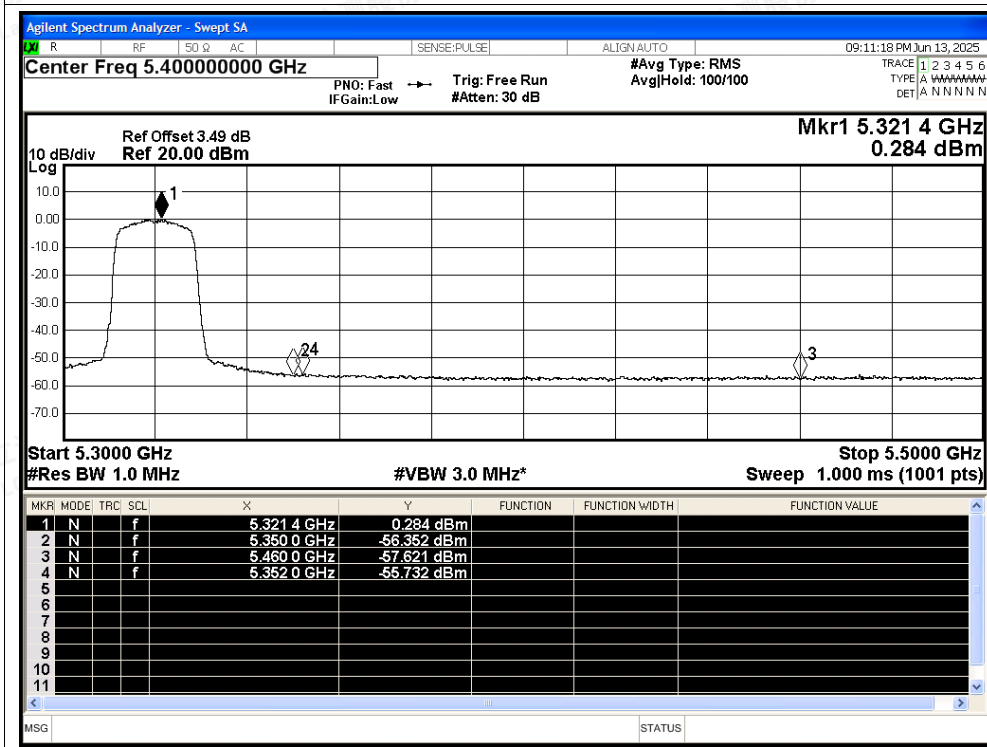

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant2 Peak

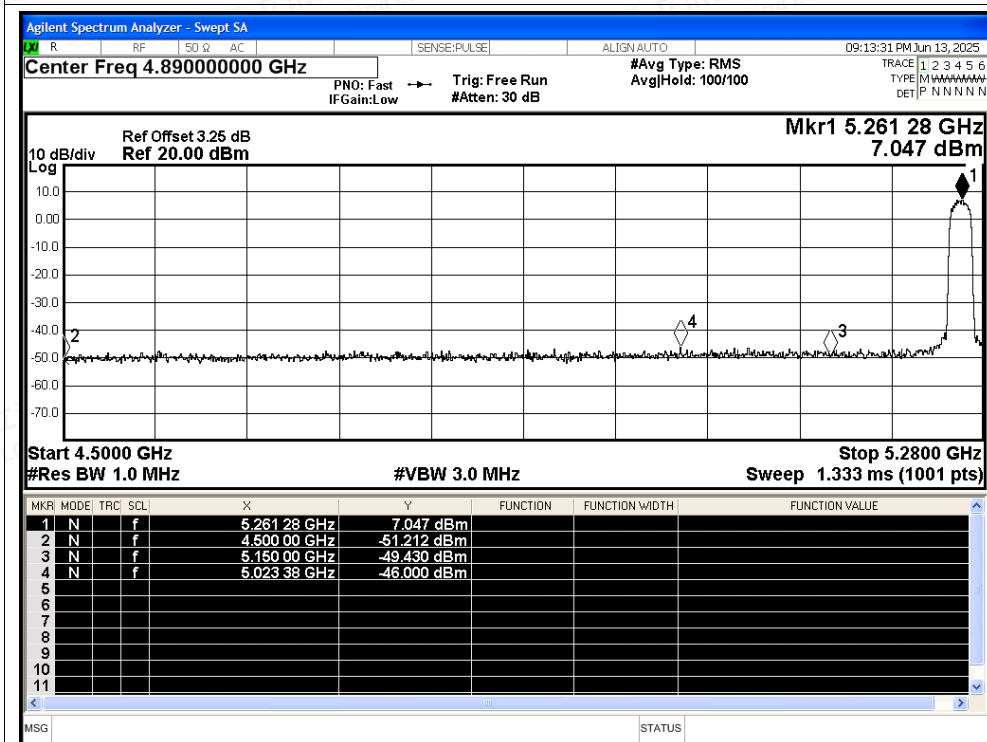

Restrict Band NVNT n20 5260MHz Ant2 Average

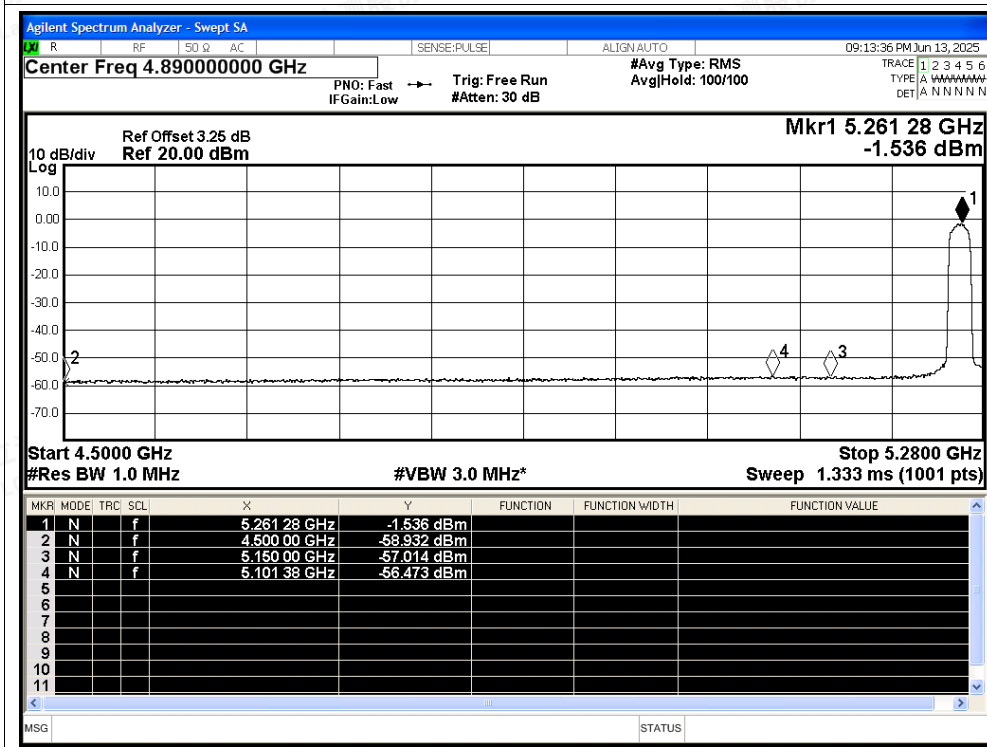

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant2 Peak

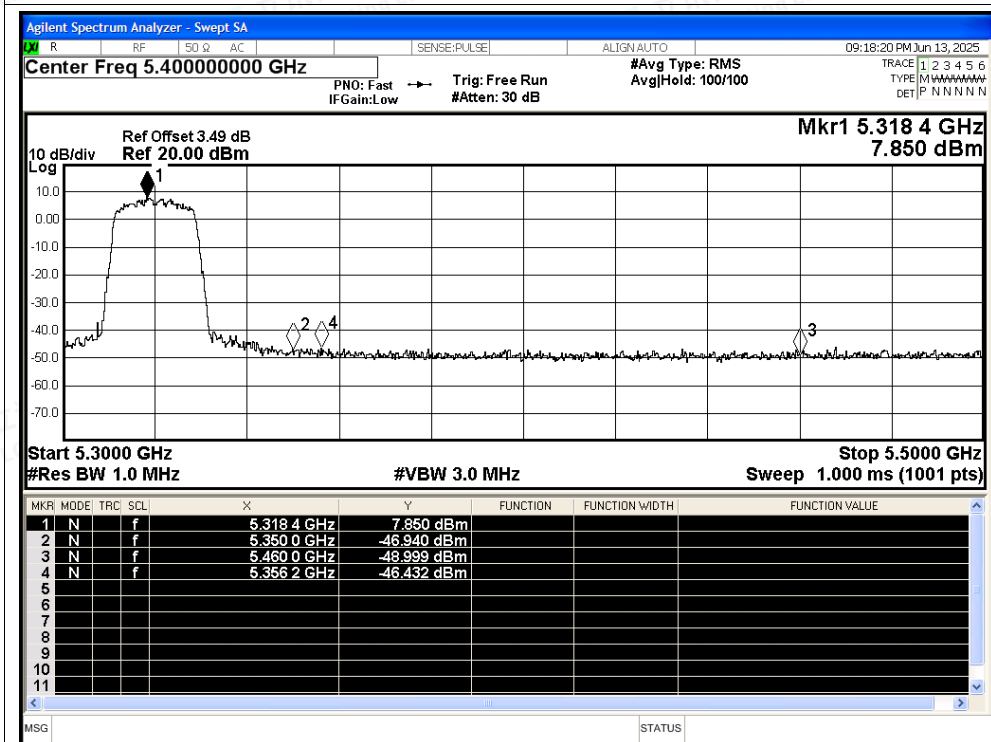

Restrict Band NVNT n20 5320MHz Ant2 Average

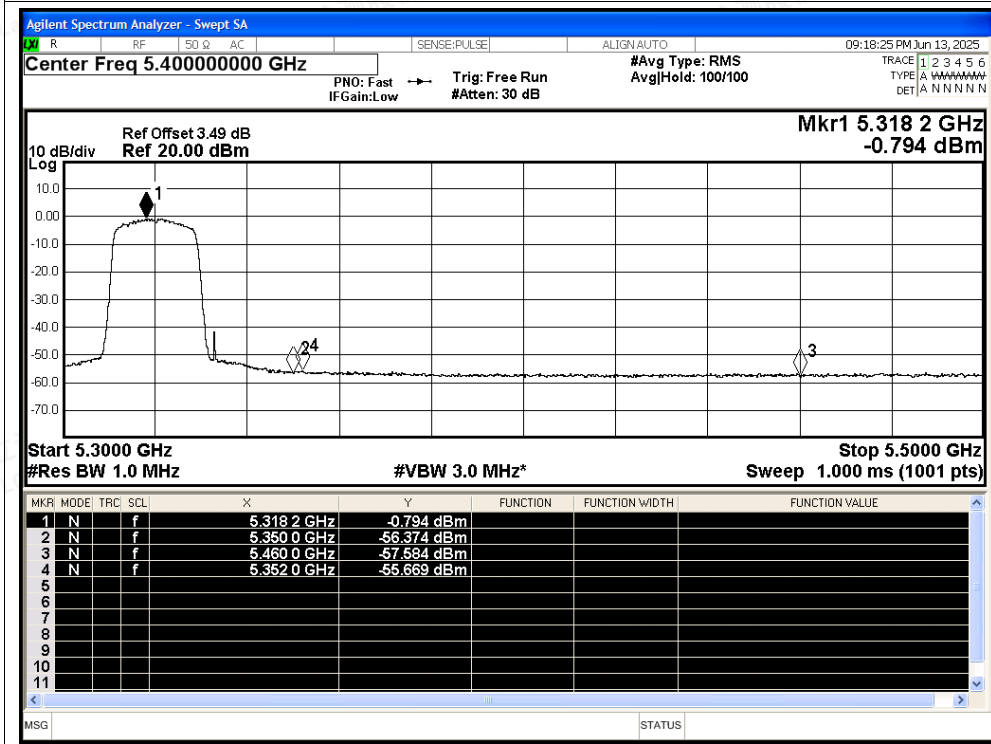

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5270MHz Ant2 Peak

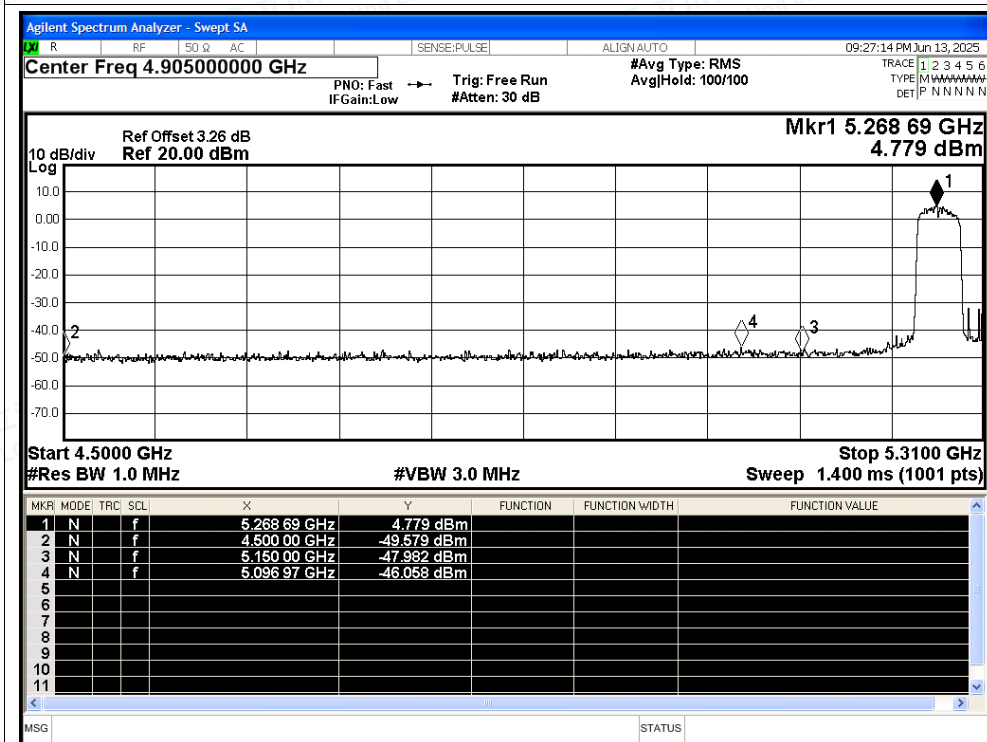

Restrict Band NVNT n40 5270MHz Ant2 Average

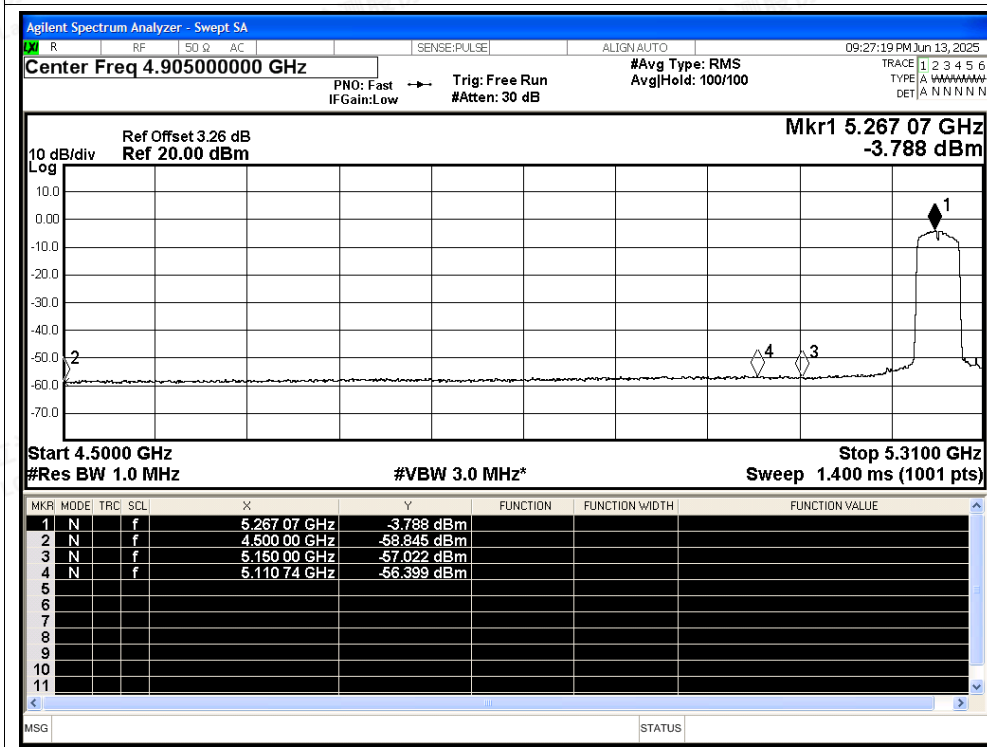

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant2 Peak

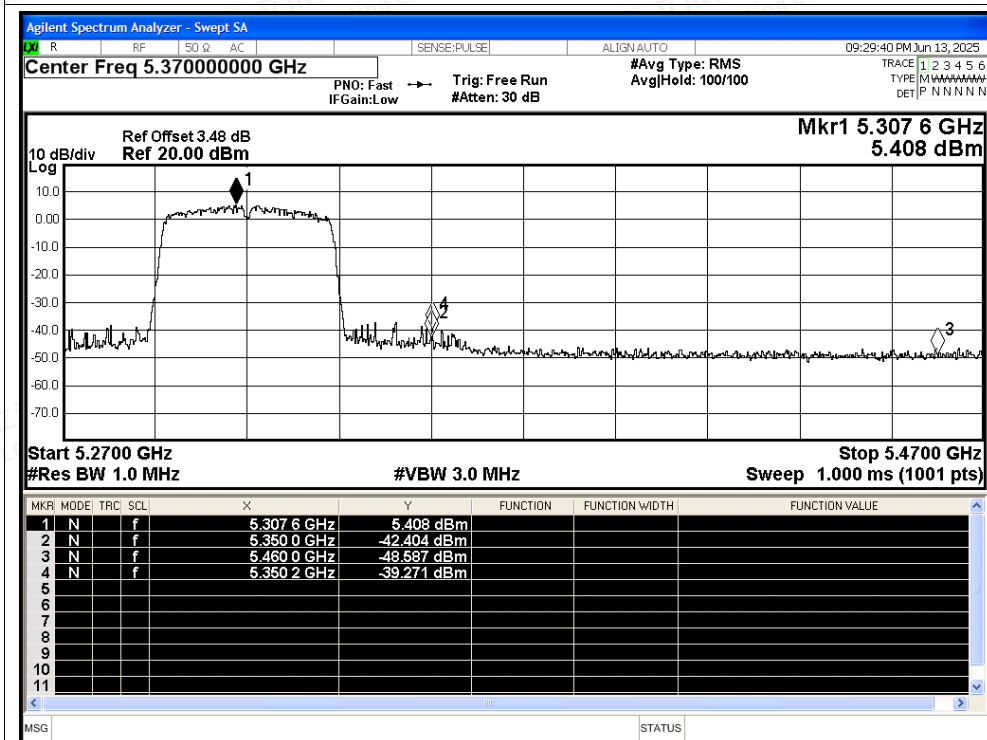

Restrict Band NVNT n40 5310MHz Ant2 Average

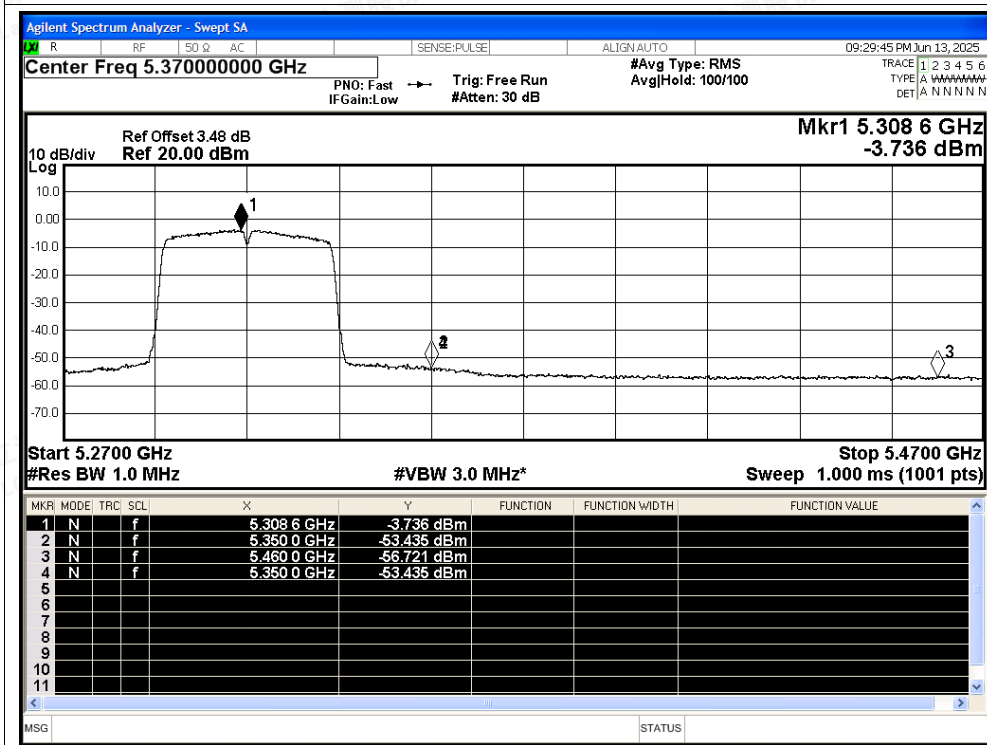

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5260MHz Ant2 Peak

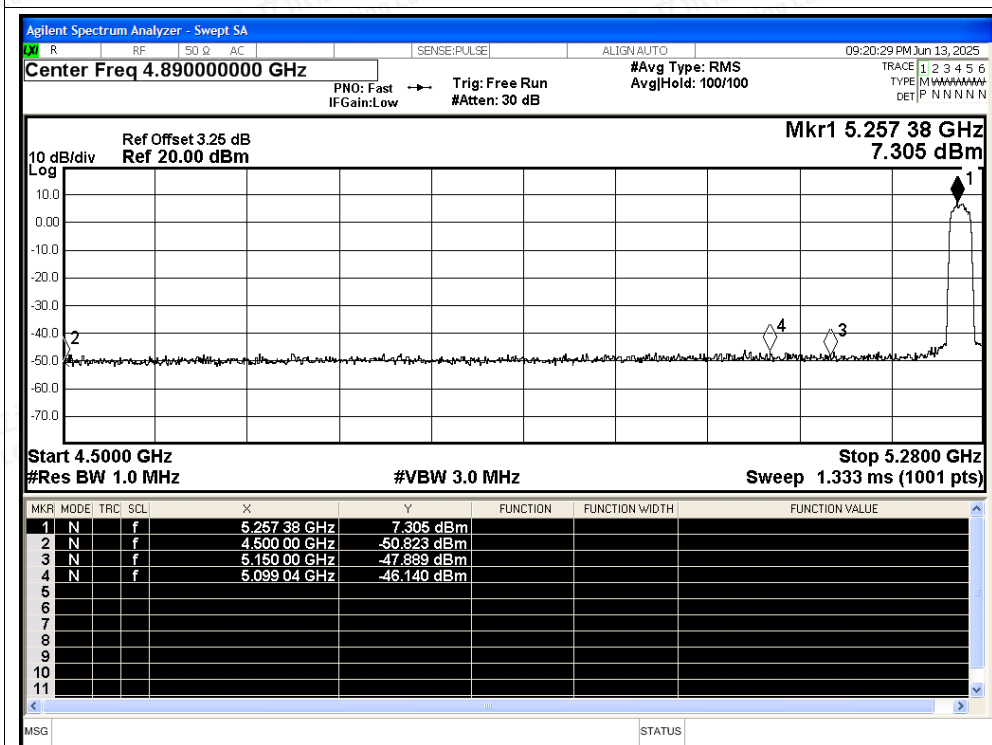

Restrict Band NVNT ac20 5260MHz Ant2 Average

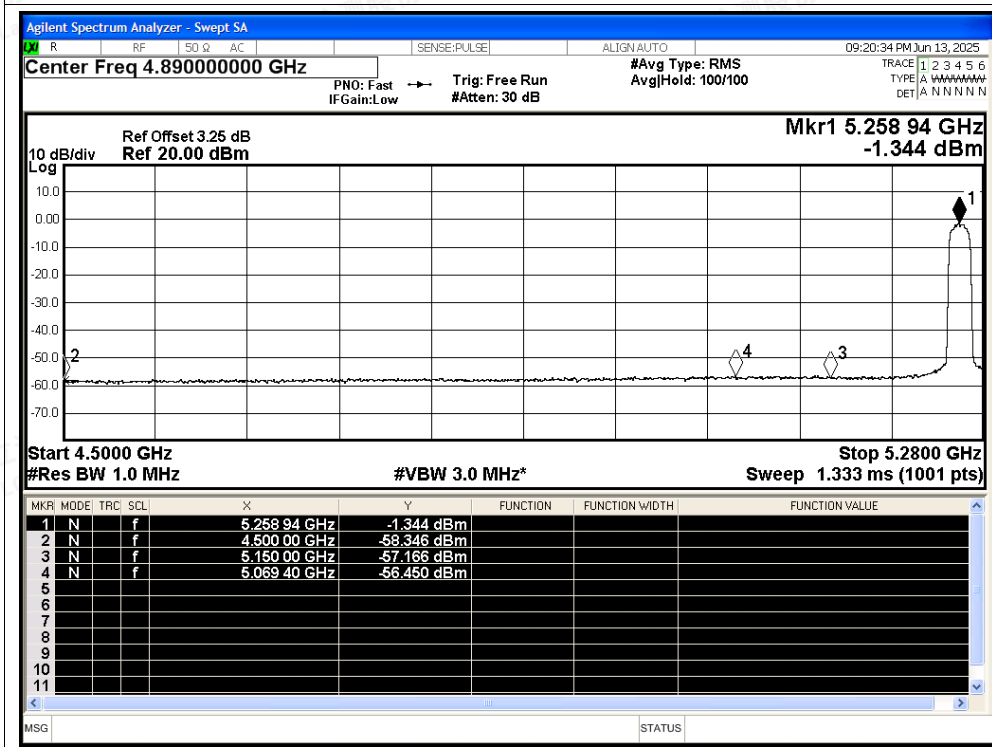

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant2 Peak

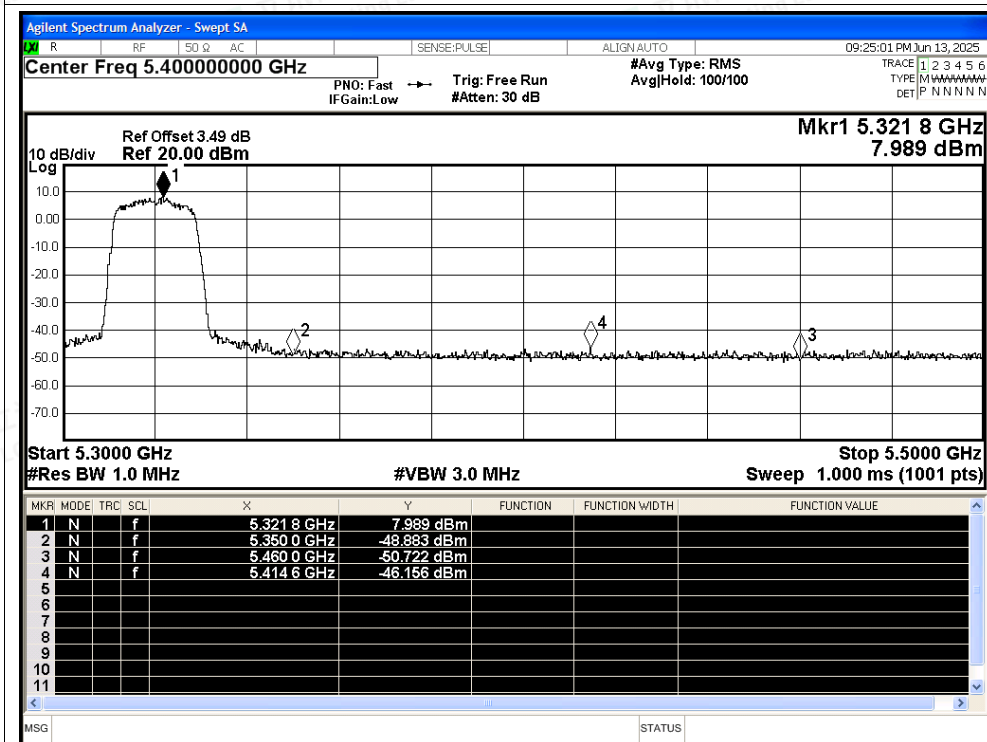

Restrict Band NVNT ac20 5320MHz Ant2 Average

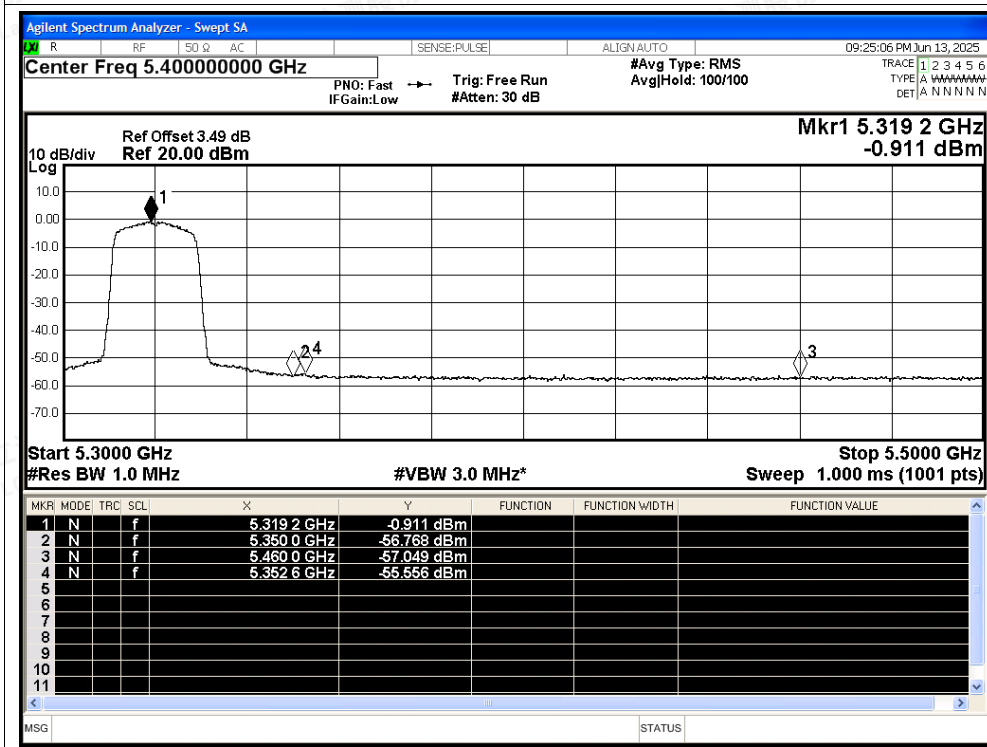

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5270MHz Ant2 Peak

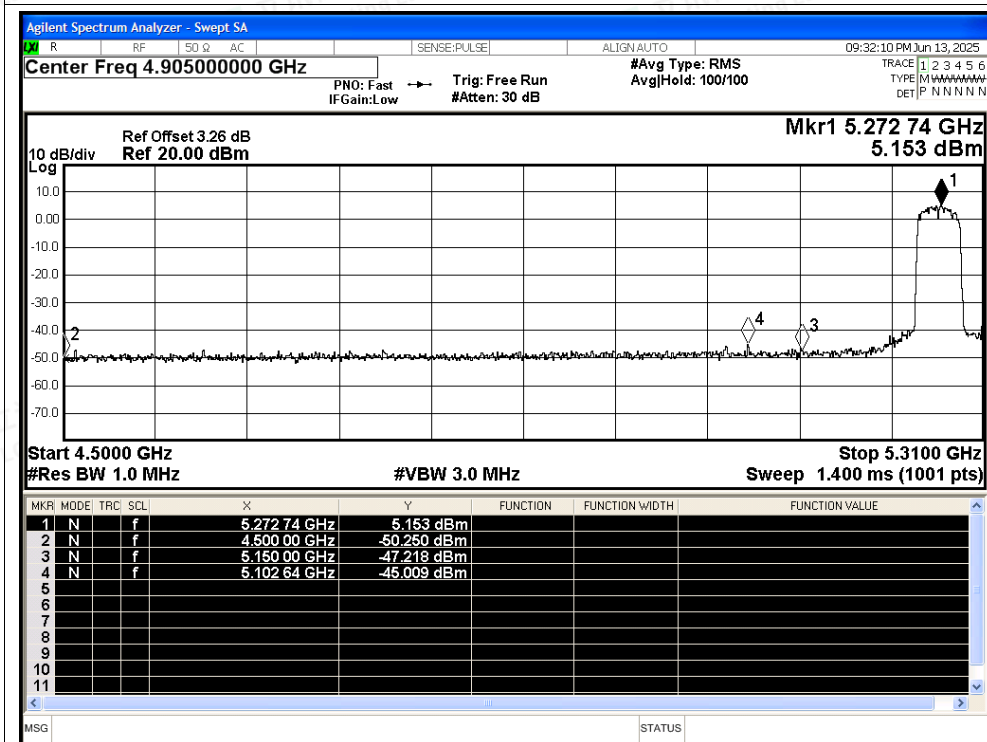

Restrict Band NVNT ac40 5270MHz Ant2 Average

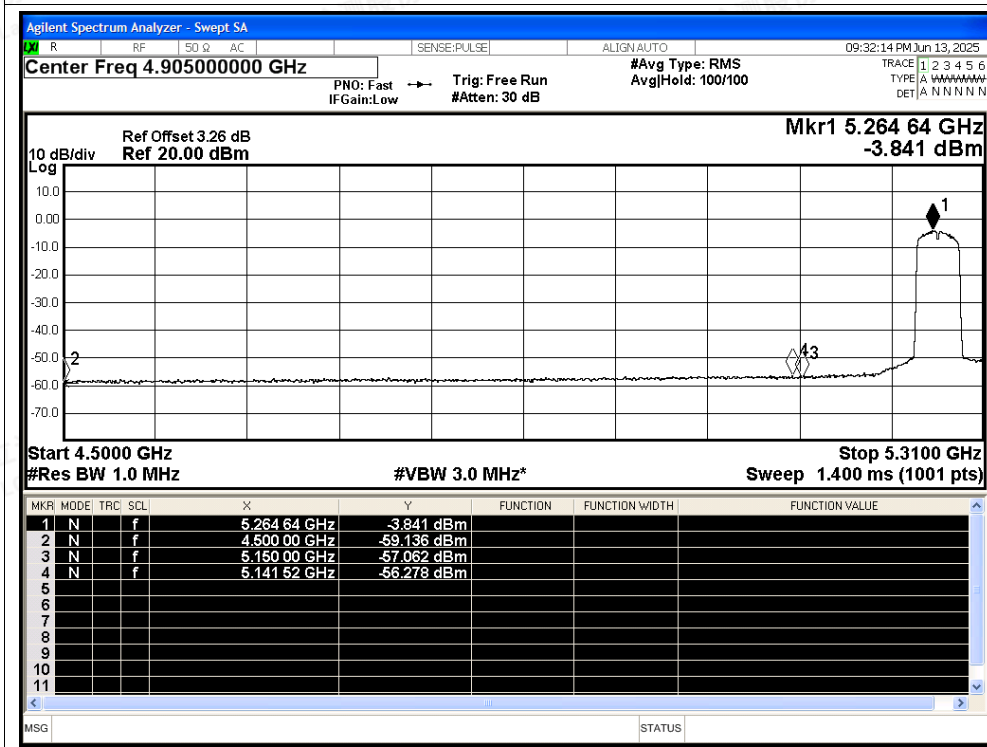

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant2 Peak

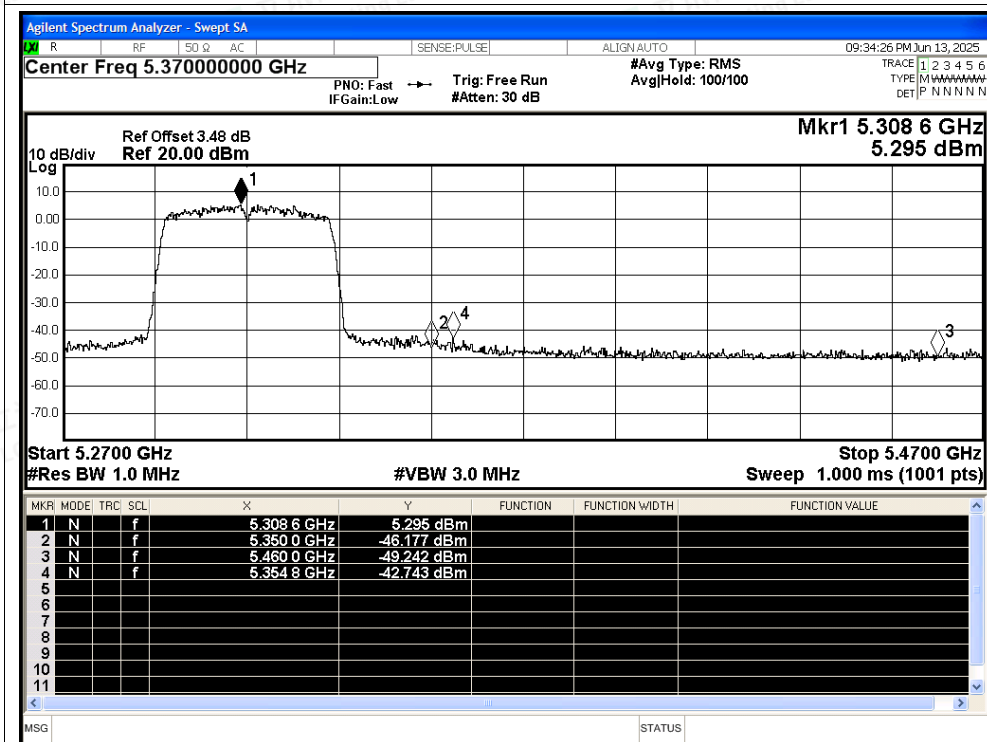

Restrict Band NVNT ac40 5310MHz Ant2 Average

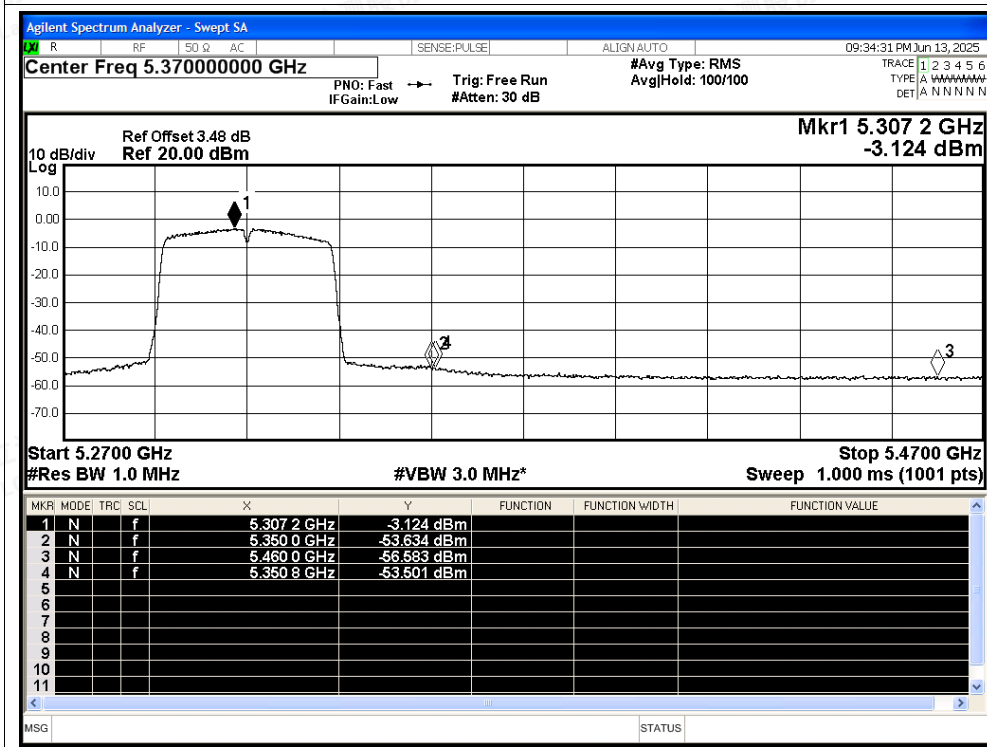

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

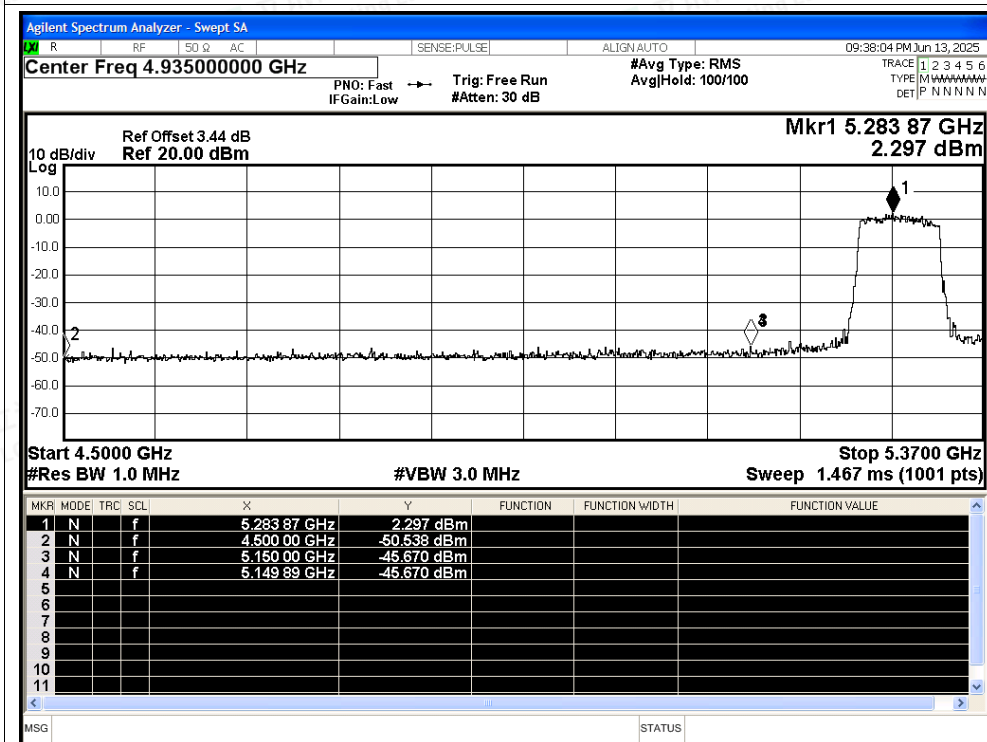

Restrict Band NVNT ac80 5290MHz Ant2 Average

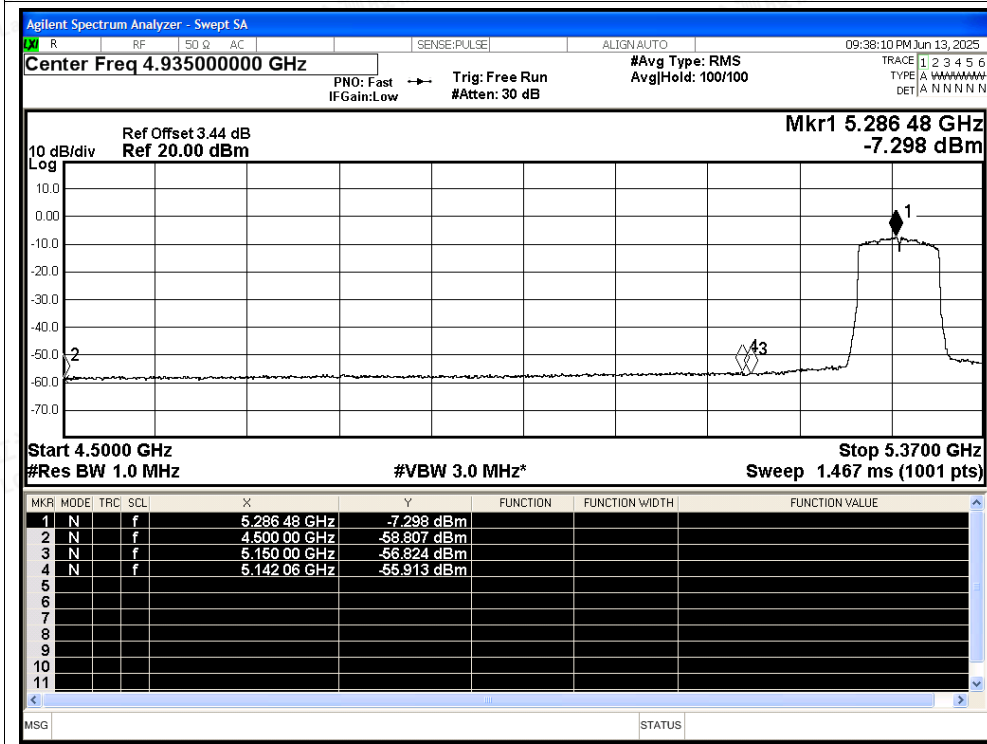

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant2 Peak

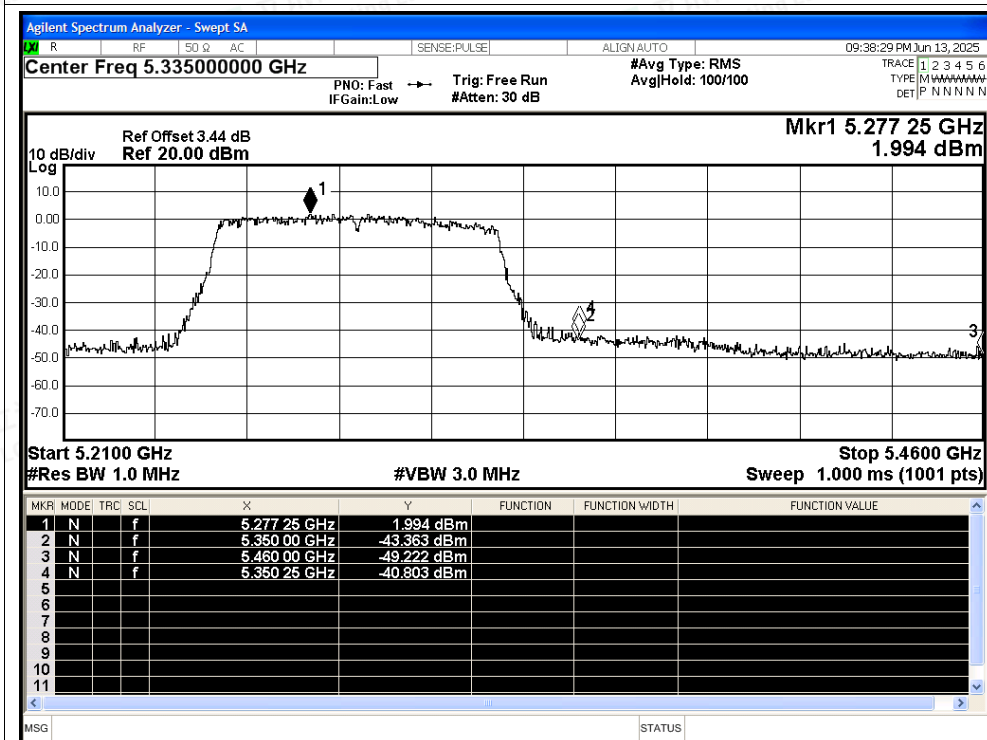

Restrict Band NVNT ac80 5290MHz Ant2 Average

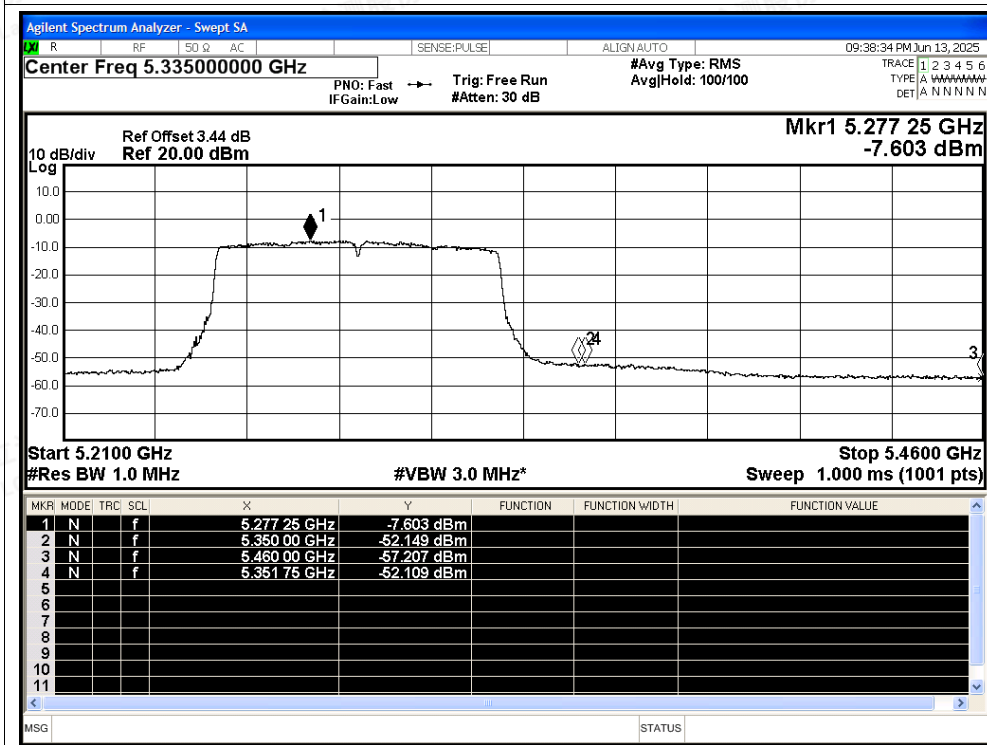

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant2 Peak

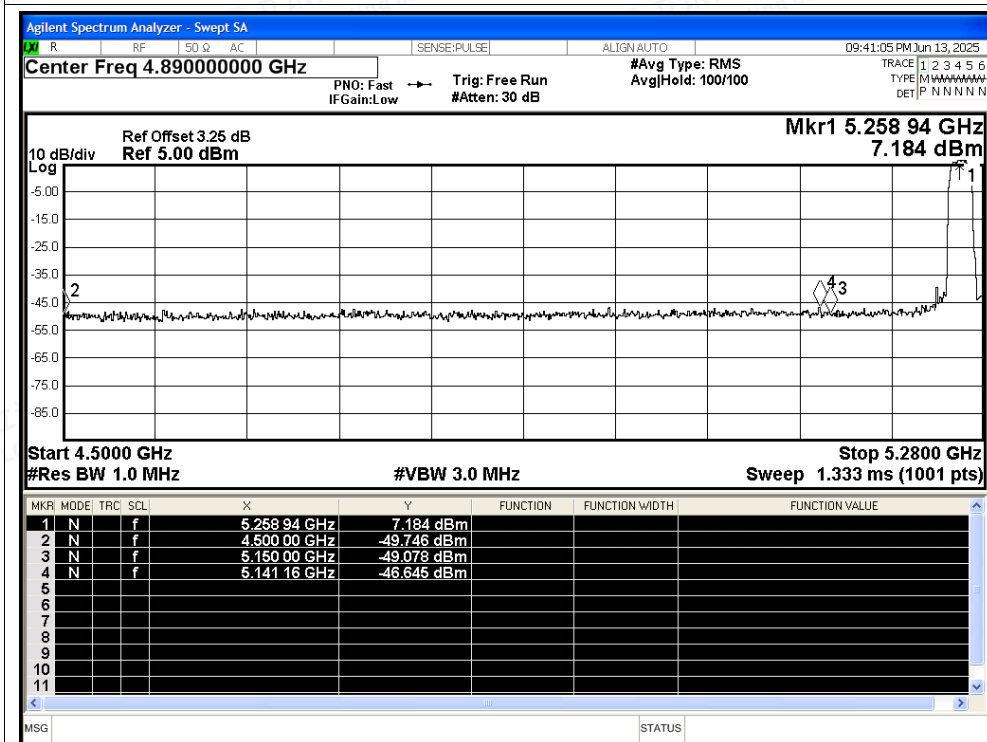

Restrict Band NVNT ax20 5260MHz Ant2 Average

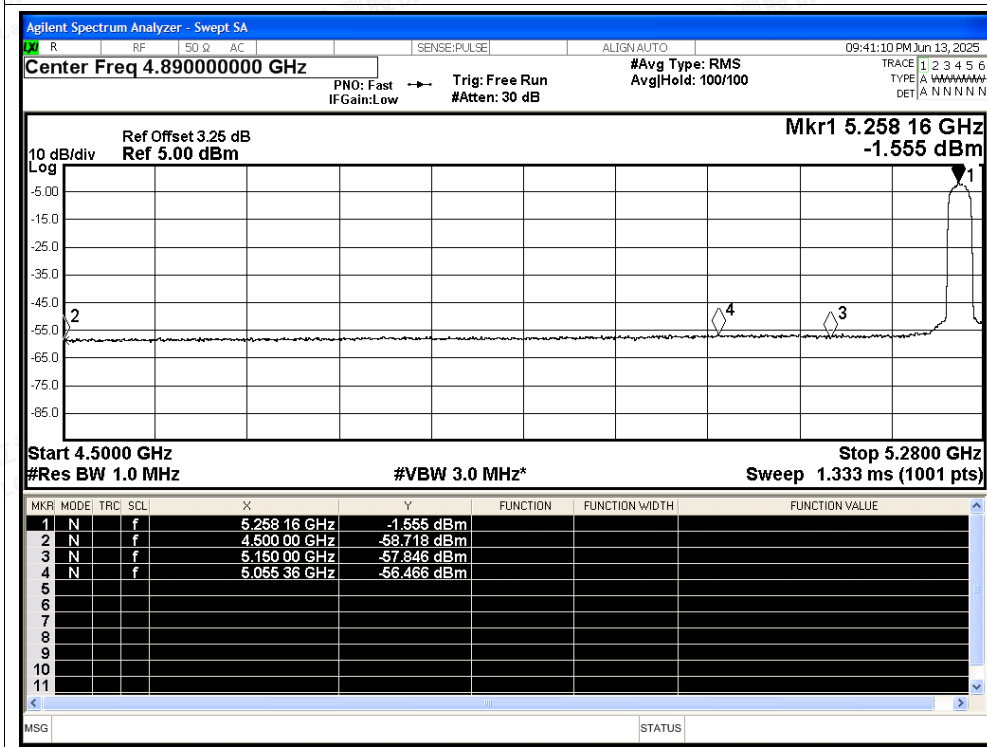

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant2 Peak

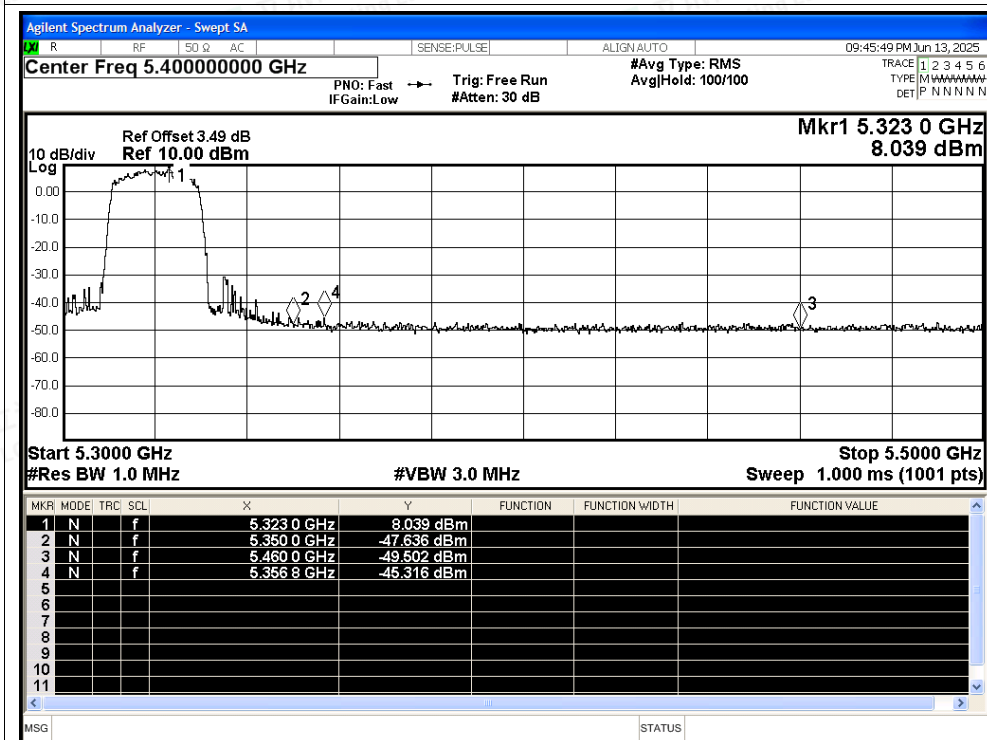

Restrict Band NVNT ax20 5320MHz Ant2 Average

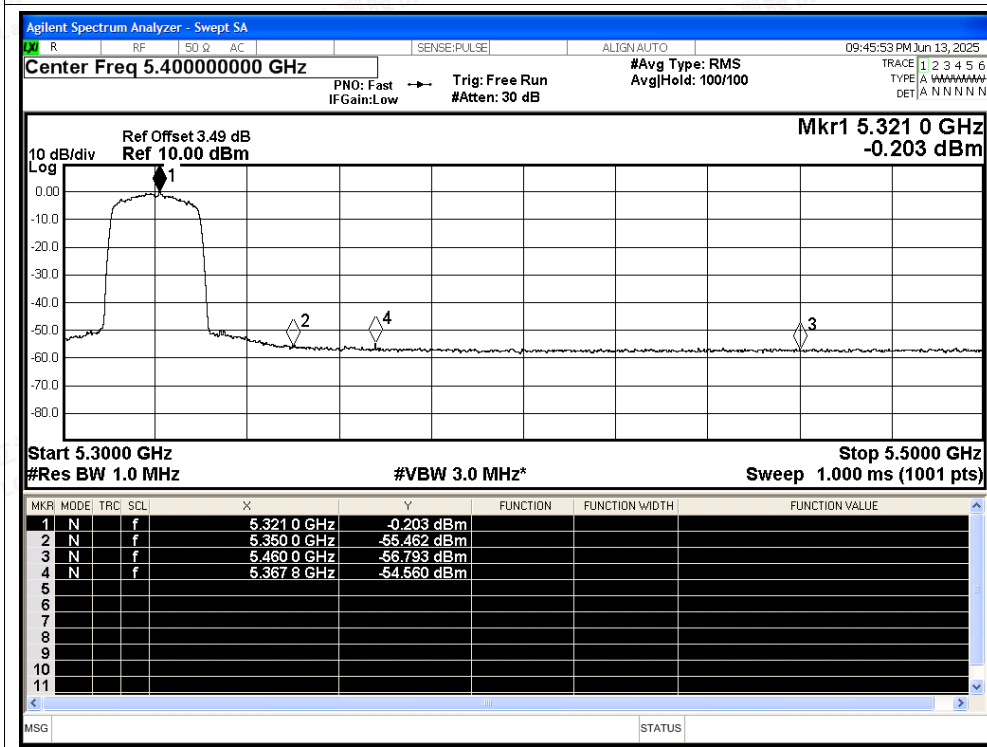

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant2 Peak

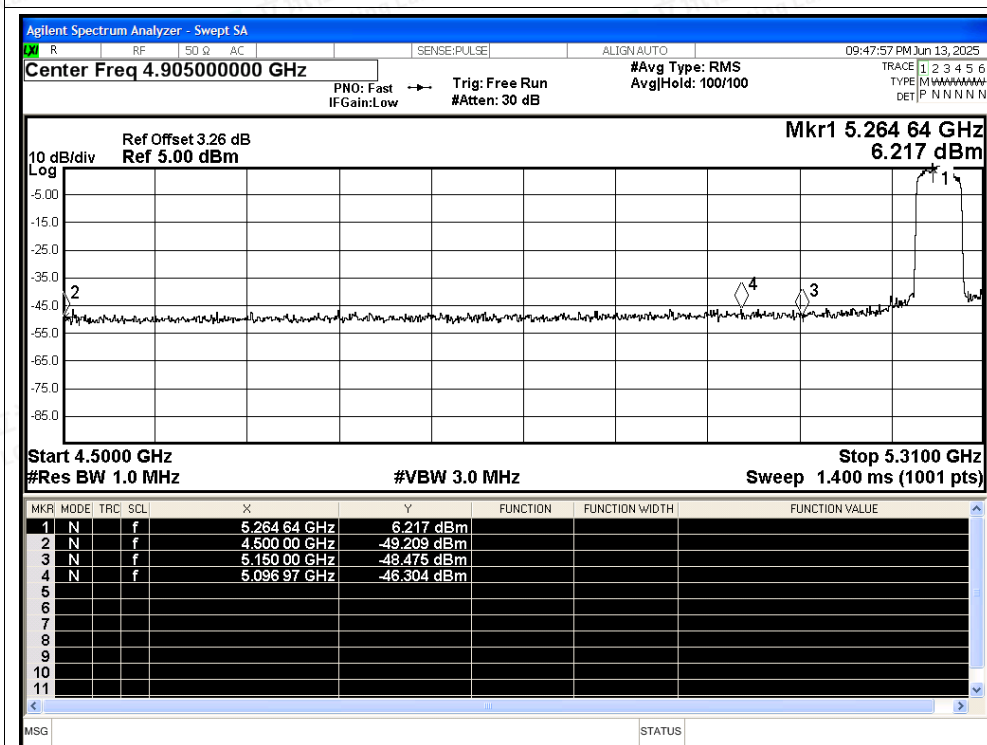

Restrict Band NVNT ax40 5270MHz Ant2 Average

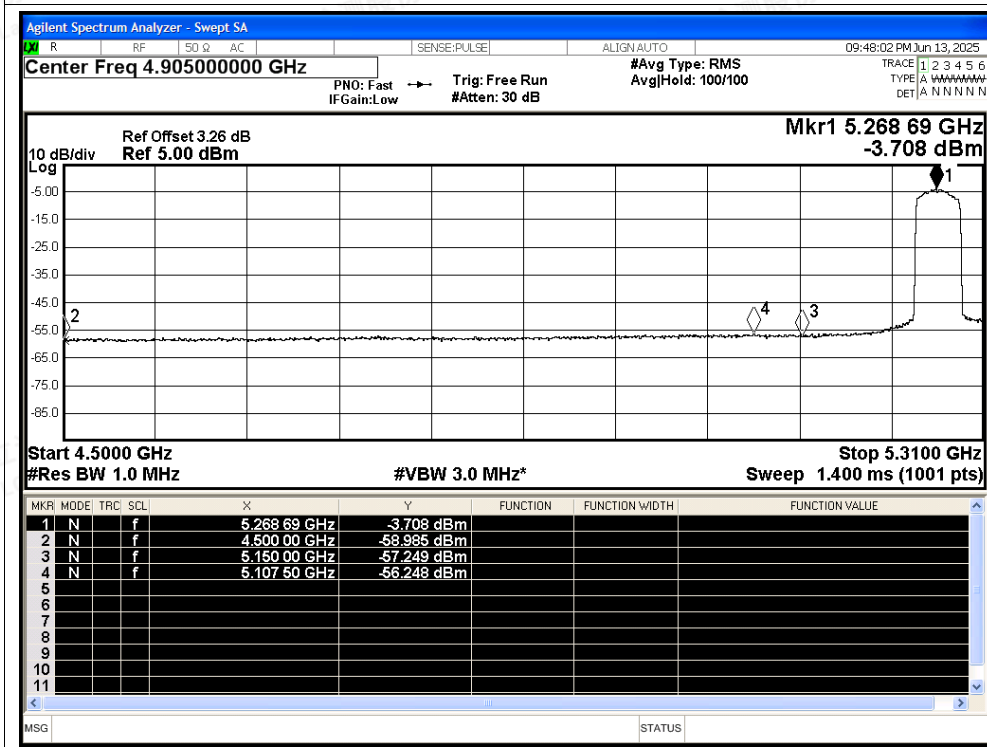

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant2 Peak

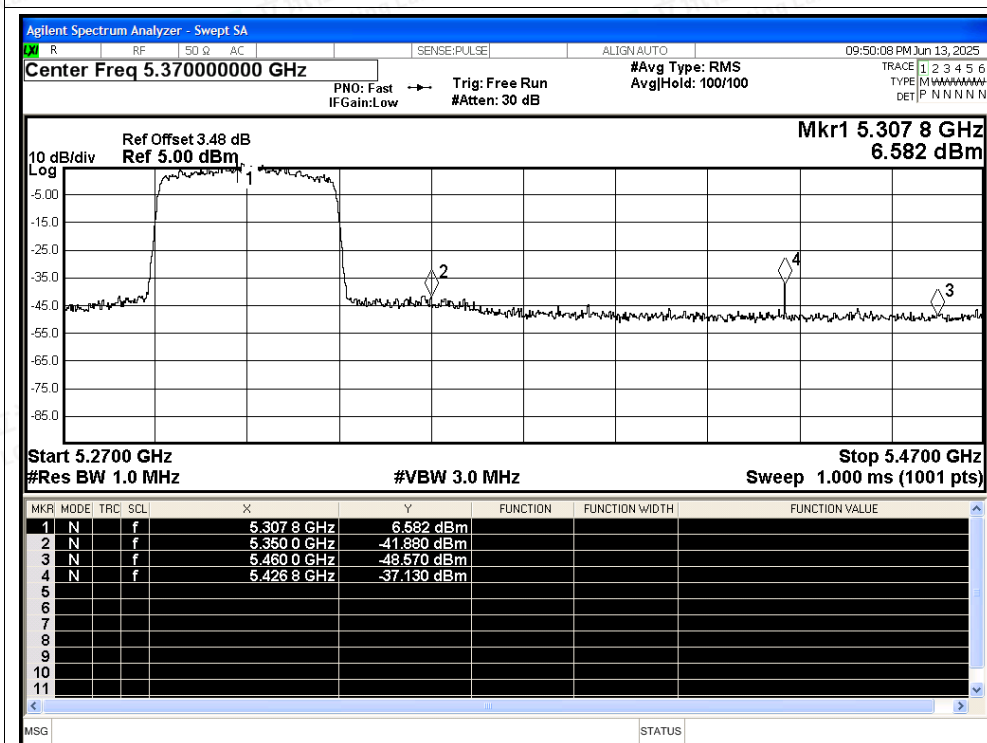

Restrict Band NVNT ax40 5310MHz Ant2 Average

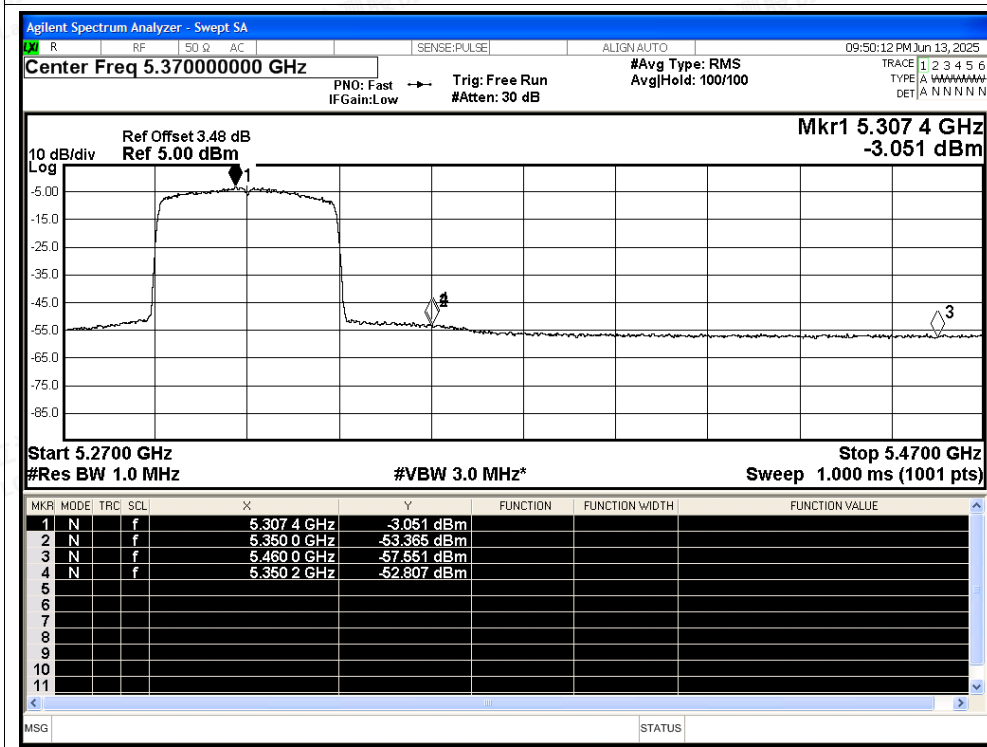

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

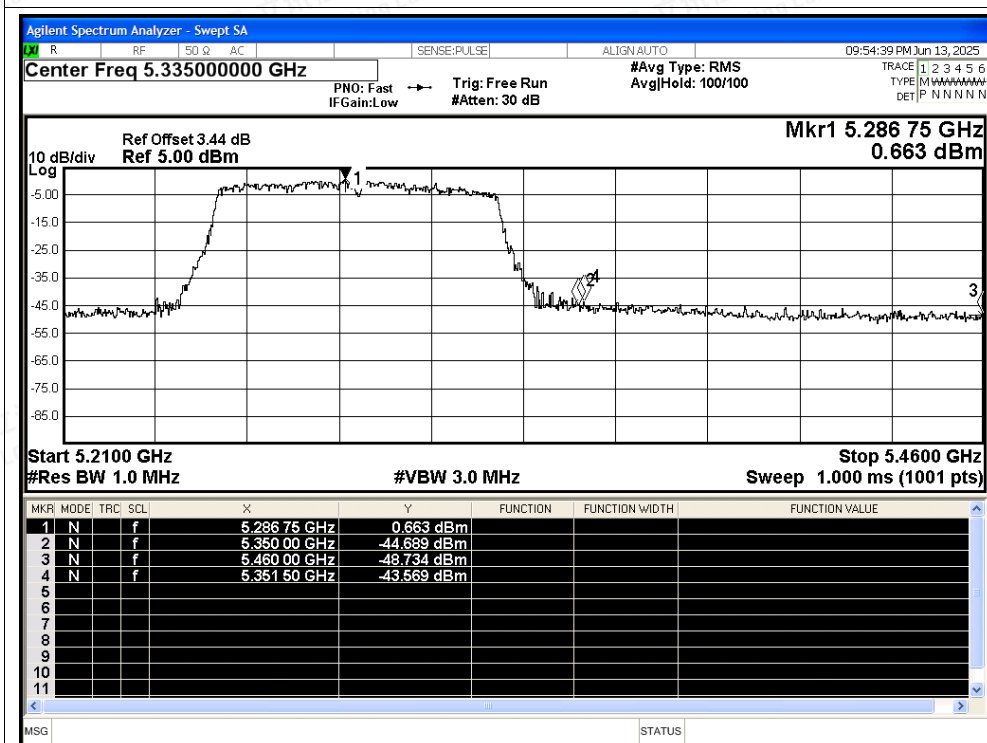

Restrict Band NVNT ax80 5290MHz Ant2 Average

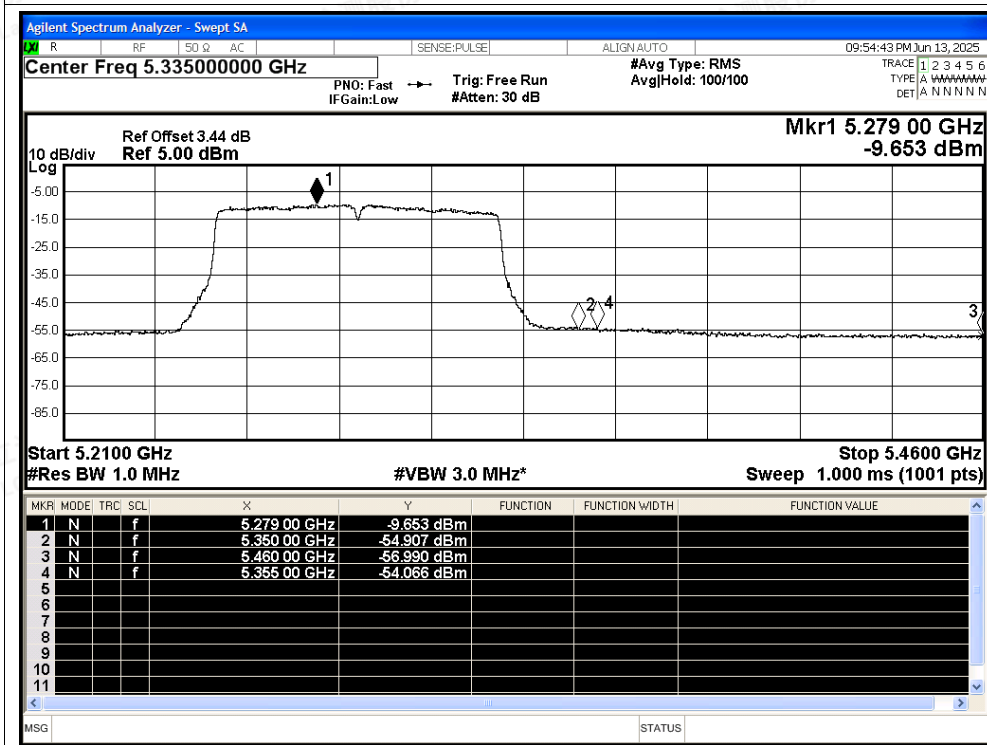

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant2 Peak

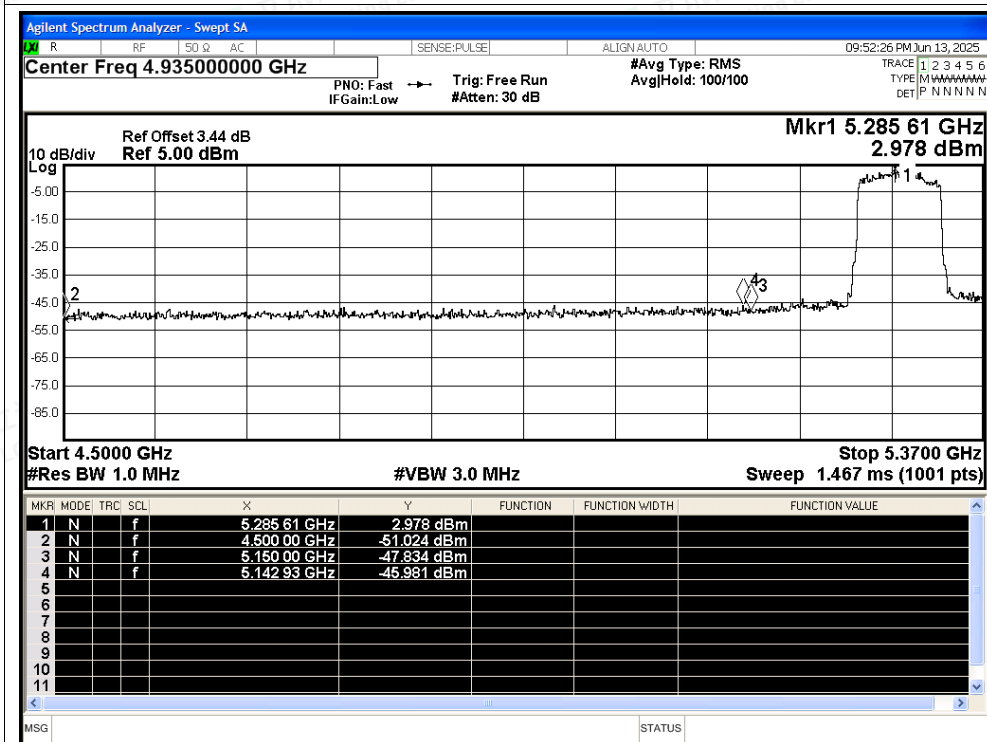

Restrict Band NVNT ax80 5290MHz Ant2 Average

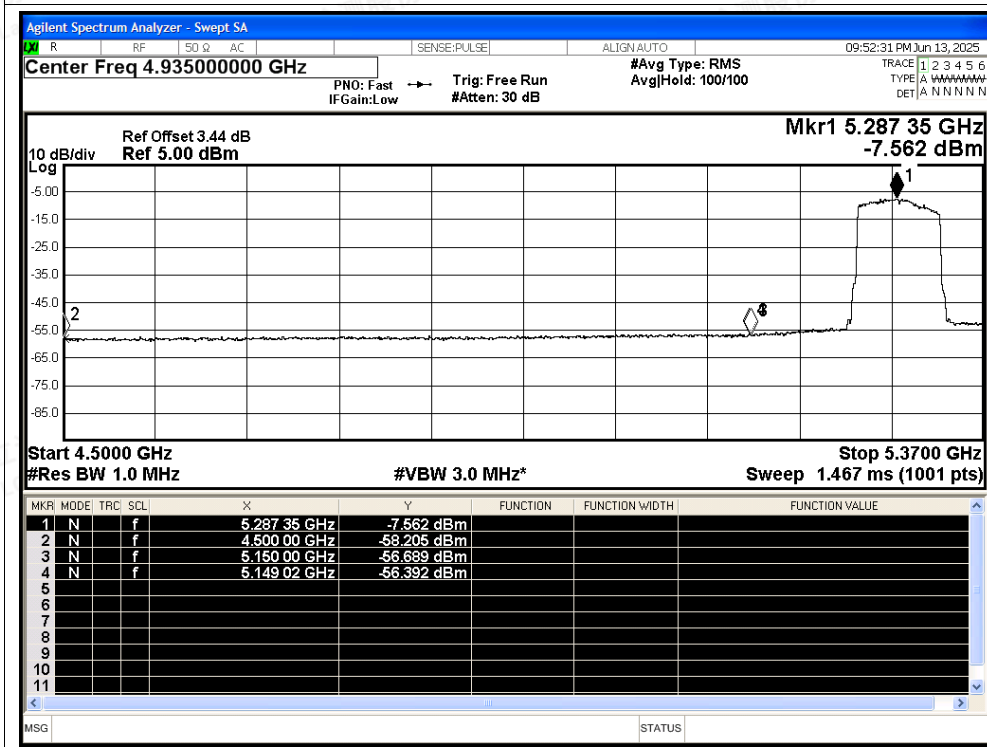

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Sum (Ant1+Ant2)	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5260	-50.57	-51.21	-47.87	5.11	52.47	Peak	68.2	Pass
NVNT	n20	5260	-59.13	-58.93	-56.02	5.11	44.32	Average	54	Pass
NVNT	n20	5260	-46.1	-46	-43.04	5.11	57.30	Peak	68.2	Pass
NVNT	n20	5260	-56.5	-56.47	-53.47	5.11	46.86	Average	54	Pass
NVNT	n20	5260	-49	-49.43	-46.20	5.11	54.14	Peak	68.2	Pass
NVNT	n20	5260	-57.05	-57.01	-54.02	5.11	46.32	Average	54	Pass
NVNT	n20	5320	-47.22	-46.94	-44.07	5.11	56.27	Peak	68.2	Pass
NVNT	n20	5320	-56.16	-56.37	-53.25	5.11	47.08	Average	54	Pass
NVNT	n20	5320	-45.43	-46.43	-42.89	5.11	57.45	Peak	68.2	Pass
NVNT	n20	5320	-55.97	-55.67	-52.81	5.11	47.53	Average	54	Pass
NVNT	n20	5320	-49.38	-49	-46.18	5.11	54.16	Peak	68.2	Pass
NVNT	n20	5320	-57.94	-57.58	-54.75	5.11	45.59	Average	54	Pass
NVNT	n40	5270	-50.04	-49.58	-46.79	5.11	53.54	Peak	68.2	Pass
NVNT	n40	5270	-58.84	-58.85	-55.83	5.11	44.50	Average	54	Pass
NVNT	n40	5270	-46.54	-46.06	-43.28	5.11	57.05	Peak	68.2	Pass
NVNT	n40	5270	-56.27	-56.4	-53.32	5.11	47.01	Average	54	Pass
NVNT	n40	5270	-48.94	-47.98	-45.42	5.11	54.91	Peak	68.2	Pass
NVNT	n40	5270	-57.01	-57.02	-54.00	5.11	46.33	Average	54	Pass
NVNT	n40	5310	-46.96	-42.4	-41.10	5.11	59.24	Peak	68.2	Pass
NVNT	n40	5310	-55.23	-53.44	-51.23	5.11	49.10	Average	54	Pass
NVNT	n40	5310	-43.92	-39.27	-37.99	5.11	62.35	Peak	68.2	Pass
NVNT	n40	5310	-54.47	-53.44	-50.91	5.11	49.42	Average	54	Pass
NVNT	n40	5310	-48.47	-48.59	-45.52	5.11	54.82	Peak	68.2	Pass
NVNT	n40	5310	-57.64	-56.72	-54.15	5.11	46.19	Average	54	Pass
NVNT	ac20	5260	-49.02	-50.82	-46.82	5.11	53.52	Peak	68.2	Pass
NVNT	ac20	5260	-59.07	-58.35	-55.68	5.11	44.65	Average	54	Pass
NVNT	ac20	5260	-45.99	-46.14	-43.05	5.11	57.28	Peak	68.2	Pass
NVNT	ac20	5260	-56.31	-56.45	-53.37	5.11	46.97	Average	54	Pass
NVNT	ac20	5260	-49.25	-47.89	-45.51	5.11	54.83	Peak	68.2	Pass
NVNT	ac20	5260	-57.45	-57.17	-54.30	5.11	46.04	Average	54	Pass
NVNT	ac20	5320	-49.66	-48.88	-46.24	5.11	54.10	Peak	68.2	Pass
NVNT	ac20	5320	-56.69	-56.77	-53.72	5.11	46.62	Average	54	Pass
NVNT	ac20	5320	-45.96	-46.16	-43.05	5.11	57.29	Peak	68.2	Pass
NVNT	ac20	5320	-55.72	-55.56	-52.63	5.11	47.71	Average	54	Pass
NVNT	ac20	5320	-47.97	-50.72	-46.12	5.11	54.22	Peak	68.2	Pass
NVNT	ac20	5320	-57.21	-57.05	-54.12	5.11	46.22	Average	54	Pass
NVNT	ac40	5270	-51.45	-50.25	-47.80	5.11	52.54	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5270	-58.94	-59.14	-56.03	5.11	44.31	Average	54	Pass
NVNT	ac40	5270	-45.83	-45.01	-42.39	5.11	57.95	Peak	68.2	Pass
NVNT	ac40	5270	-56.47	-56.28	-53.36	5.11	46.97	Average	54	Pass
NVNT	ac40	5270	-48.27	-47.22	-44.70	5.11	55.63	Peak	68.2	Pass
NVNT	ac40	5270	-57.61	-57.06	-54.32	5.11	46.02	Average	54	Pass
NVNT	ac40	5310	-45.98	-46.18	-43.07	5.11	57.27	Peak	68.2	Pass
NVNT	ac40	5310	-55.3	-53.63	-51.37	5.11	48.96	Average	54	Pass
NVNT	ac40	5310	-44.03	-42.74	-40.33	5.11	60.01	Peak	68.2	Pass
NVNT	ac40	5310	-54.11	-53.5	-50.78	5.11	49.55	Average	54	Pass
NVNT	ac40	5310	-48	-49.24	-45.57	5.11	54.77	Peak	68.2	Pass
NVNT	ac40	5310	-57.08	-56.58	-53.81	5.11	46.53	Average	54	Pass
NVNT	ac80	5290	-48.32	-50.54	-46.28	5.11	54.06	Peak	68.2	Pass
NVNT	ac80	5290	-58.56	-58.81	-55.67	5.11	44.66	Average	54	Pass
NVNT	ac80	5290	-45.47	-45.67	-42.56	5.11	57.78	Peak	68.2	Pass
NVNT	ac80	5290	-55.79	-55.91	-52.84	5.11	47.50	Average	54	Pass
NVNT	ac80	5290	-45.93	-45.67	-42.79	5.11	57.55	Peak	68.2	Pass
NVNT	ac80	5290	-56.3	-56.82	-53.54	5.11	46.80	Average	54	Pass
NVNT	ac80	5290	-46.91	-43.36	-41.77	5.11	58.57	Peak	68.2	Pass
NVNT	ac80	5290	-54.56	-52.15	-50.18	5.11	50.16	Average	54	Pass
NVNT	ac80	5290	-43.24	-40.8	-38.84	5.11	61.50	Peak	68.2	Pass
NVNT	ac80	5290	-54.54	-52.11	-50.15	5.11	50.19	Average	54	Pass
NVNT	ac80	5290	-48.72	-49.22	-45.95	5.11	54.39	Peak	68.2	Pass
NVNT	ac80	5290	-57.31	-57.21	-54.25	5.11	46.09	Average	54	Pass
NVNT	ax20	5260	-49.21	-49.75	-46.46	5.11	53.88	Peak	68.2	Pass
NVNT	ax20	5260	-58.98	-58.72	-55.84	5.11	44.50	Average	54	Pass
NVNT	ax20	5260	-46.19	-46.65	-43.40	5.11	56.93	Peak	68.2	Pass
NVNT	ax20	5260	-56.42	-56.47	-53.43	5.11	46.90	Average	54	Pass
NVNT	ax20	5260	-48.85	-49.08	-45.95	5.11	54.38	Peak	68.2	Pass
NVNT	ax20	5260	-57.44	-57.85	-54.63	5.11	45.71	Average	54	Pass
NVNT	ax20	5320	-49.72	-47.64	-45.55	5.11	54.79	Peak	68.2	Pass
NVNT	ax20	5320	-56.59	-55.46	-52.98	5.11	47.36	Average	54	Pass
NVNT	ax20	5320	-46.28	-45.32	-42.76	5.11	57.57	Peak	68.2	Pass
NVNT	ax20	5320	-55.92	-54.56	-52.18	5.11	48.16	Average	54	Pass
NVNT	ax20	5320	-47.29	-49.5	-45.25	5.11	55.09	Peak	68.2	Pass
NVNT	ax20	5320	-57.19	-56.79	-53.98	5.11	46.36	Average	54	Pass
NVNT	ax40	5270	-50.38	-49.21	-46.75	5.11	53.59	Peak	68.2	Pass
NVNT	ax40	5270	-58.68	-58.99	-55.82	5.11	44.52	Average	54	Pass
NVNT	ax40	5270	-45.24	-46.3	-42.73	5.11	57.61	Peak	68.2	Pass
NVNT	ax40	5270	-56.48	-56.25	-53.35	5.11	46.98	Average	54	Pass
NVNT	ax40	5270	-48.06	-48.48	-45.25	5.11	55.08	Peak	68.2	Pass
NVNT	ax40	5270	-57.26	-57.25	-54.24	5.11	46.09	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5310	-47.24	-41.88	-40.77	5.11	59.57	Peak	68.2	Pass
NVNT	ax40	5310	-55.23	-53.37	-51.19	5.11	49.15	Average	54	Pass
NVNT	ax40	5310	-42.46	-37.13	-36.01	5.11	64.32	Peak	68.2	Pass
NVNT	ax40	5310	-54.14	-52.81	-50.41	5.11	49.92	Average	54	Pass
NVNT	ax40	5310	-49.03	-48.57	-45.78	5.11	54.55	Peak	68.2	Pass
NVNT	ax40	5310	-57.48	-57.55	-54.50	5.11	45.83	Average	54	Pass
NVNT	ax80	5290	-45.75	-44.69	-42.18	5.11	58.16	Peak	68.2	Pass
NVNT	ax80	5290	-55.26	-54.91	-52.07	5.11	48.27	Average	54	Pass
NVNT	ax80	5290	-43.07	-43.57	-40.30	5.11	60.04	Peak	68.2	Pass
NVNT	ax80	5290	-54.85	-54.07	-51.43	5.11	48.91	Average	54	Pass
NVNT	ax80	5290	-50.84	-48.73	-46.65	5.11	53.69	Peak	68.2	Pass
NVNT	ax80	5290	-57.52	-56.99	-54.24	5.11	46.10	Average	54	Pass
NVNT	ax80	5290	-50.75	-51.02	-47.87	5.11	52.46	Peak	68.2	Pass
NVNT	ax80	5290	-58.69	-58.21	-55.43	5.11	44.90	Average	54	Pass
NVNT	ax80	5290	-45.18	-45.98	-42.55	5.11	57.79	Peak	68.2	Pass
NVNT	ax80	5290	-56.14	-56.39	-53.25	5.11	47.08	Average	54	Pass
NVNT	ax80	5290	-47.6	-47.83	-44.70	5.11	55.63	Peak	68.2	Pass
NVNT	ax80	5290	-56.78	-56.69	-53.72	5.11	46.61	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant1	5259.9	-100000	-19.01	25	Pass
NVNT	a	5300	Ant1	5299.92	-80000	-15.09	25	Pass
NVNT	a	5320	Ant1	5319.9	-100000	-18.8	25	Pass
NVNT	n20	5260	Ant1	5259.94	-60000	-11.41	25	Pass
NVNT	n20	5300	Ant1	5299.92	-80000	-15.09	25	Pass
NVNT	n20	5320	Ant1	5319.92	-80000	-15.04	25	Pass
NVNT	n40	5270	Ant1	5269.96	-40000	-7.59	25	Pass
NVNT	n40	5310	Ant1	5309.92	-80000	-15.07	25	Pass
NVNT	ac20	5260	Ant1	5259.9	-100000	-19.01	25	Pass
NVNT	ac20	5300	Ant1	5299.92	-80000	-15.09	25	Pass
NVNT	ac20	5320	Ant1	5319.9	-100000	-18.8	25	Pass
NVNT	ac40	5270	Ant1	5269.92	-80000	-15.18	25	Pass
NVNT	ac40	5310	Ant1	5309.88	-120000	-22.6	25	Pass
NVNT	ac80	5290	Ant1	5289.92	-80000	-15.12	25	Pass
NVNT	ax20	5260	Ant1	5259.92	-80000	-15.21	25	Pass
NVNT	ax20	5300	Ant1	5299.9	-100000	-18.87	25	Pass
NVNT	ax20	5320	Ant1	5319.92	-80000	-15.04	25	Pass
NVNT	ax40	5270	Ant1	5269.88	-120000	-22.77	25	Pass
NVNT	ax40	5310	Ant1	5309.88	-120000	-22.6	25	Pass
NVNT	ax80	5290	Ant1	5289.92	-80000	-15.12	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5260MHz Ant1

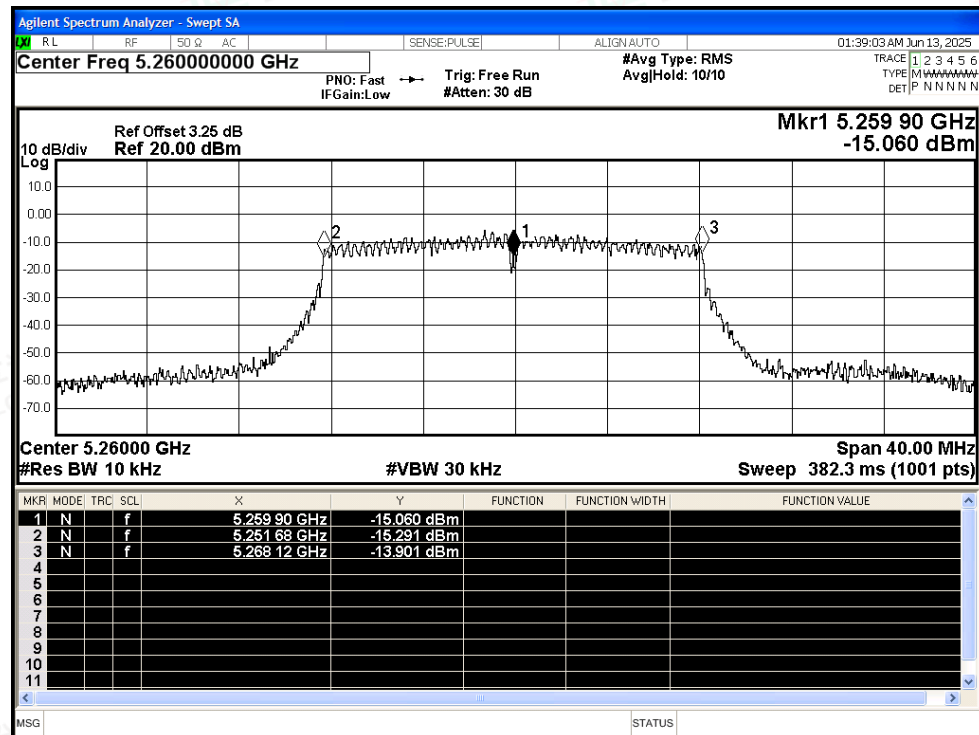

Freq. Stability NVNT a 5300MHz Ant1

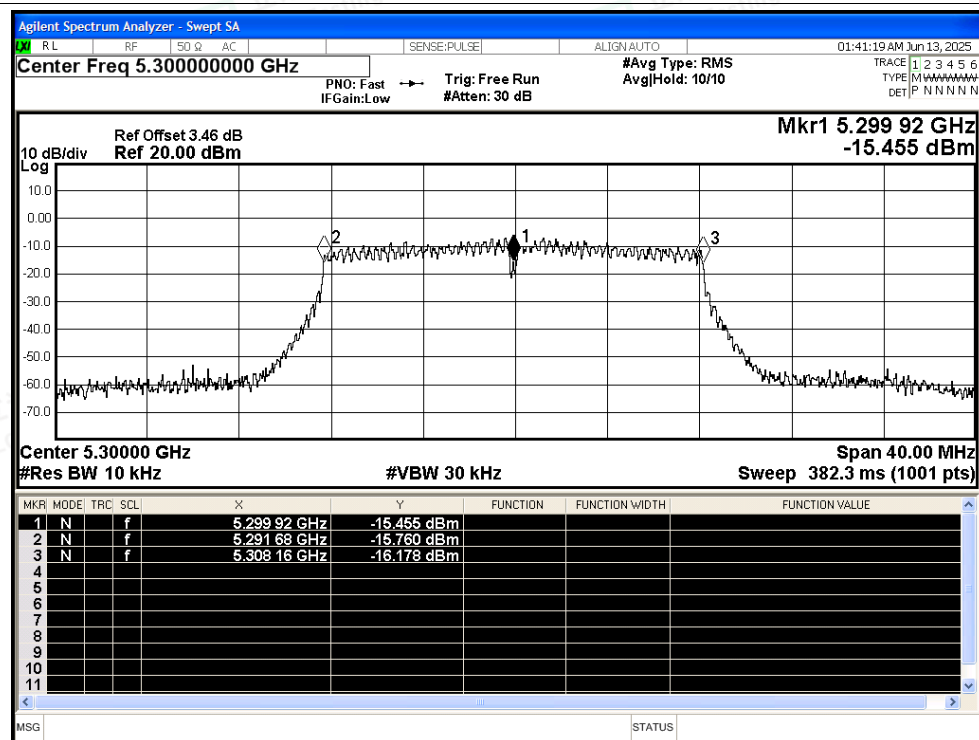

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant1

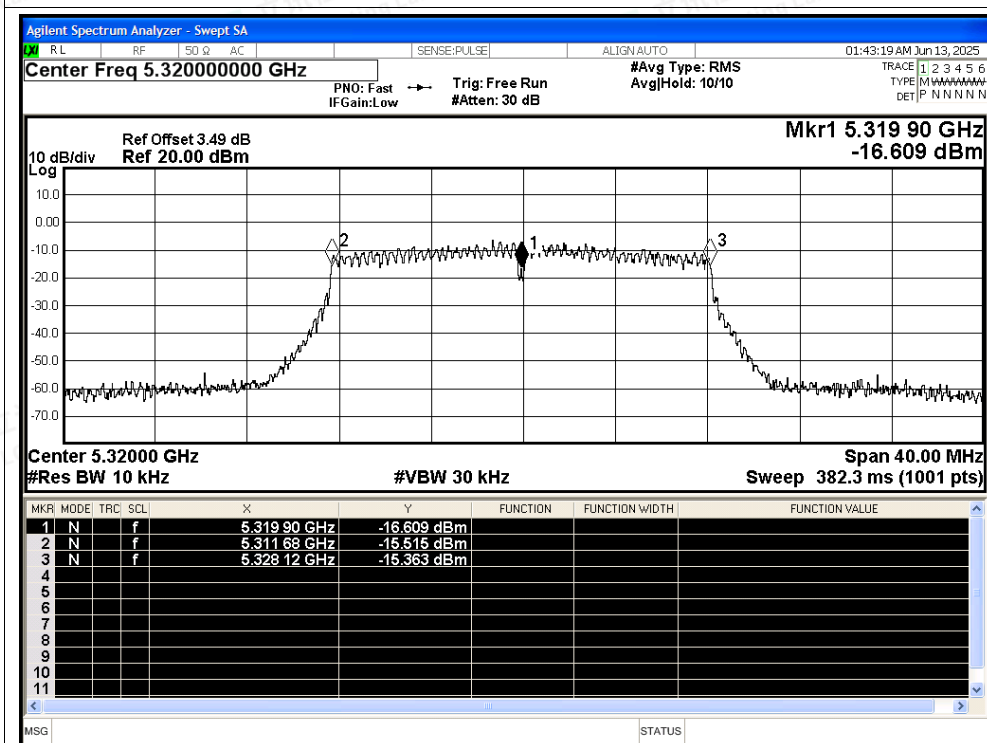

Freq. Stability NVNT n20 5260MHz Ant1

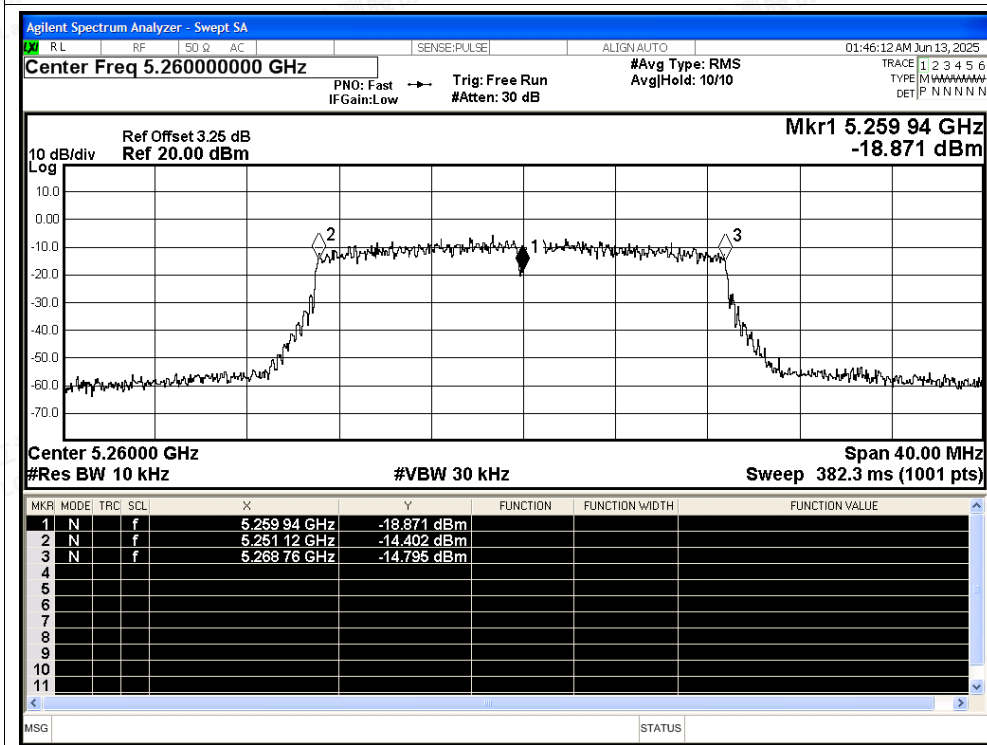

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant1

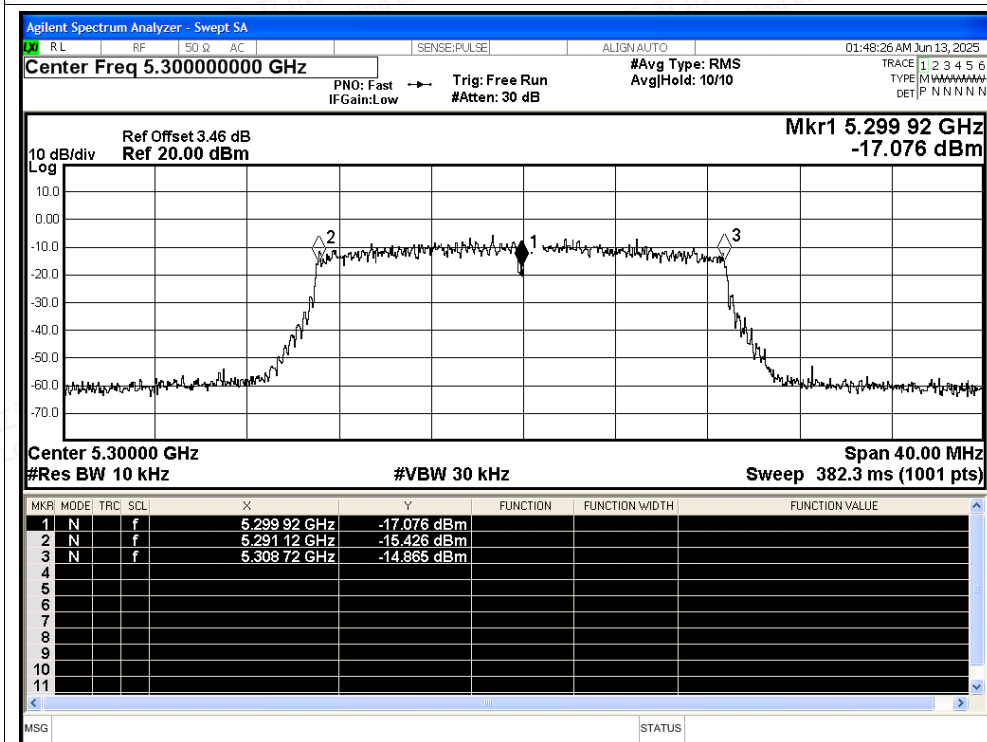

Freq. Stability NVNT n20 5320MHz Ant1

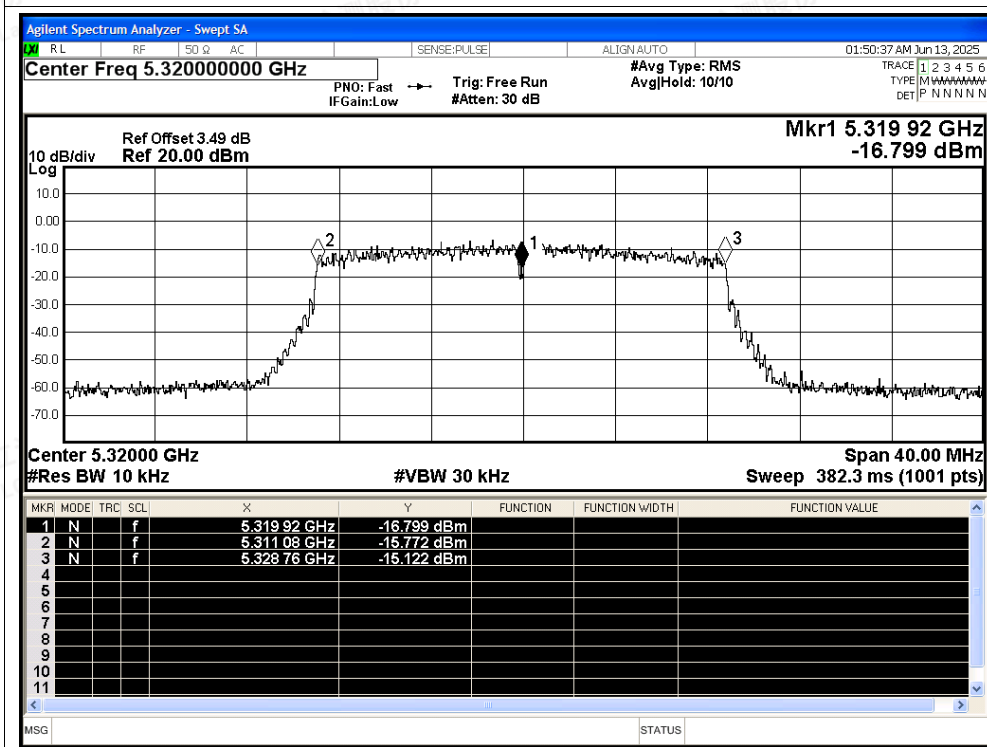

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant1

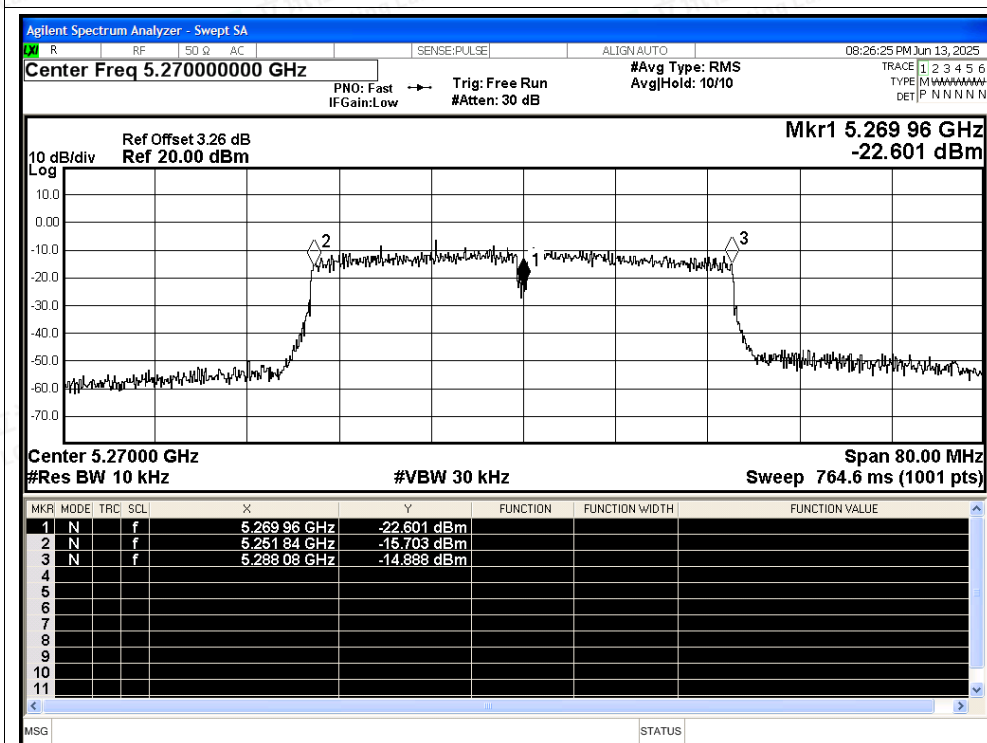

Freq. Stability NVNT n40 5310MHz Ant1

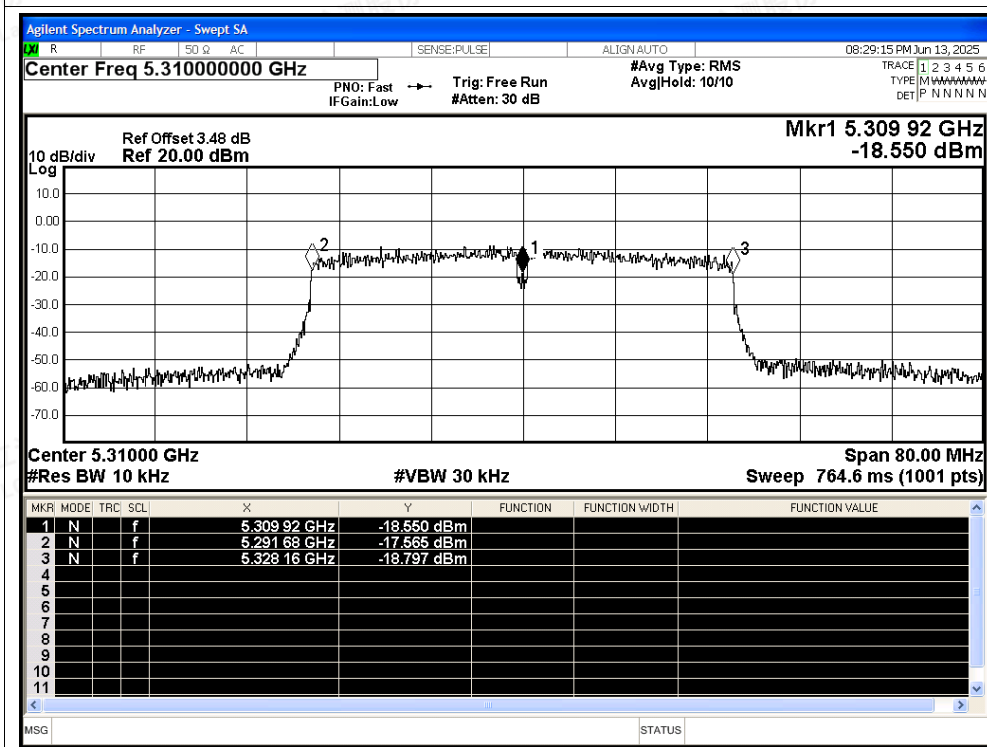

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant1

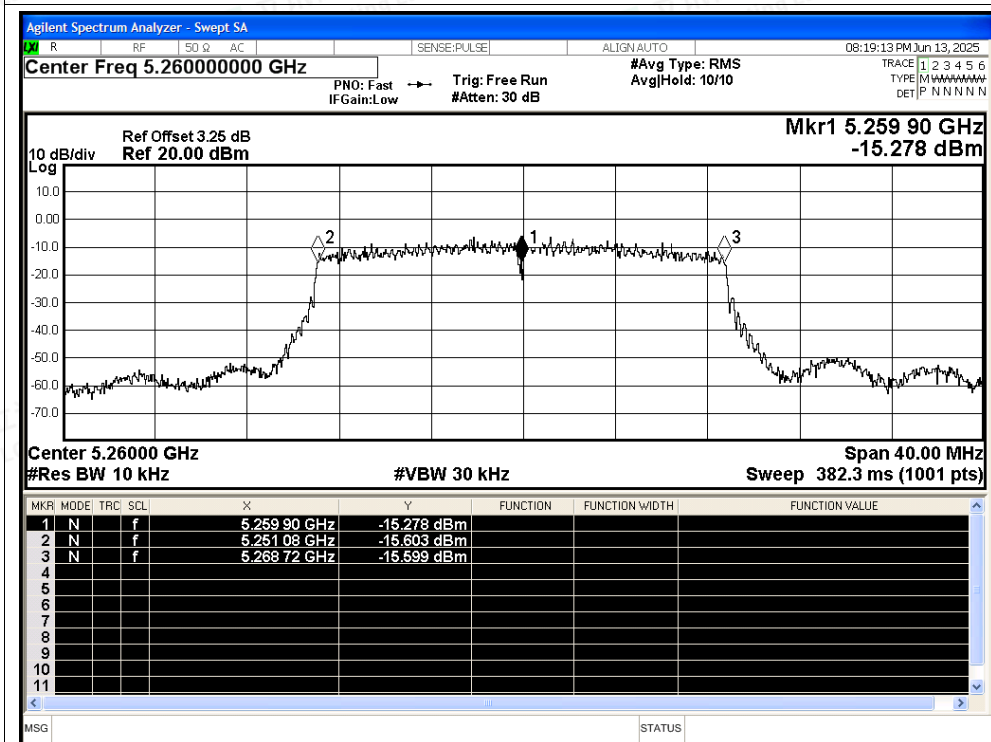

Freq. Stability NVNT ac20 5300MHz Ant1

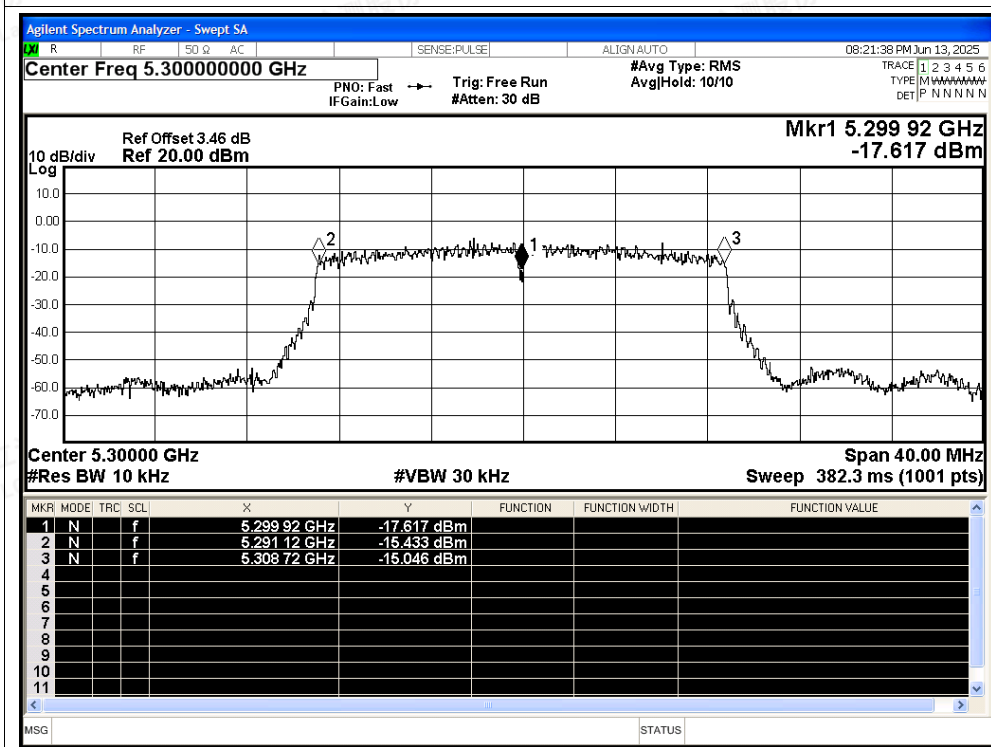

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant1

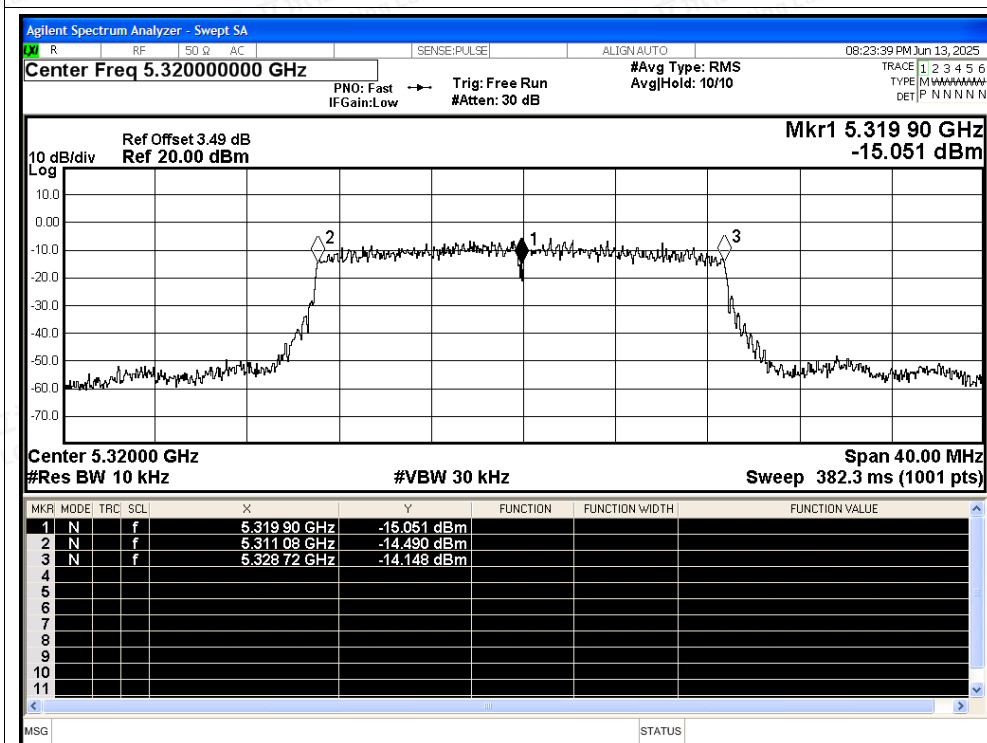

Freq. Stability NVNT ac40 5270MHz Ant1

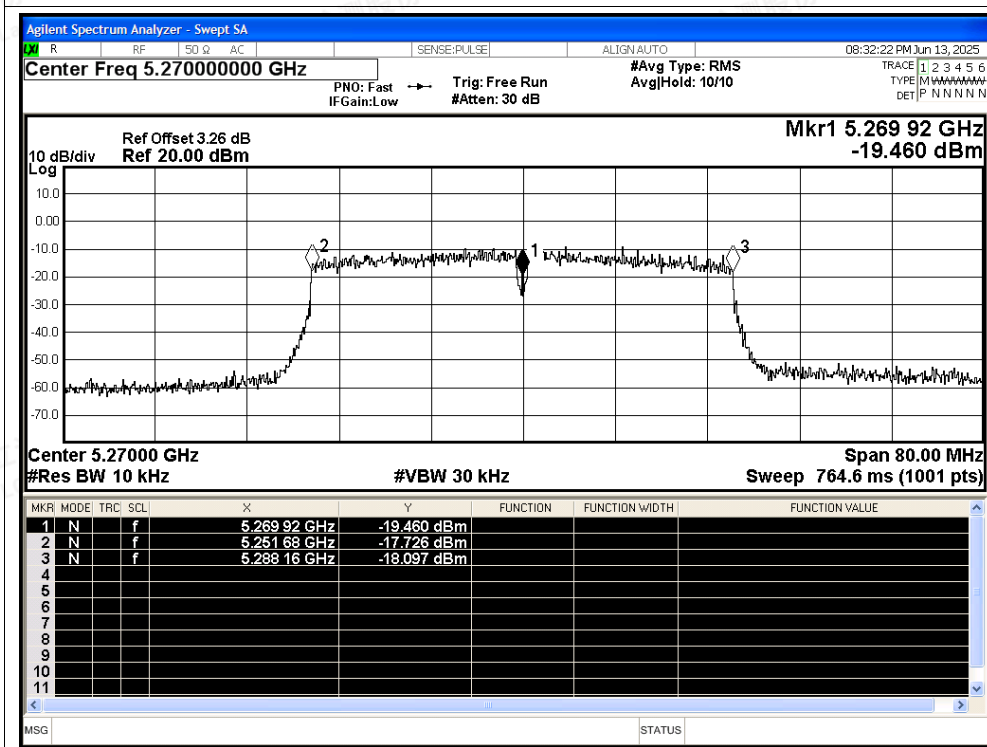

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant1

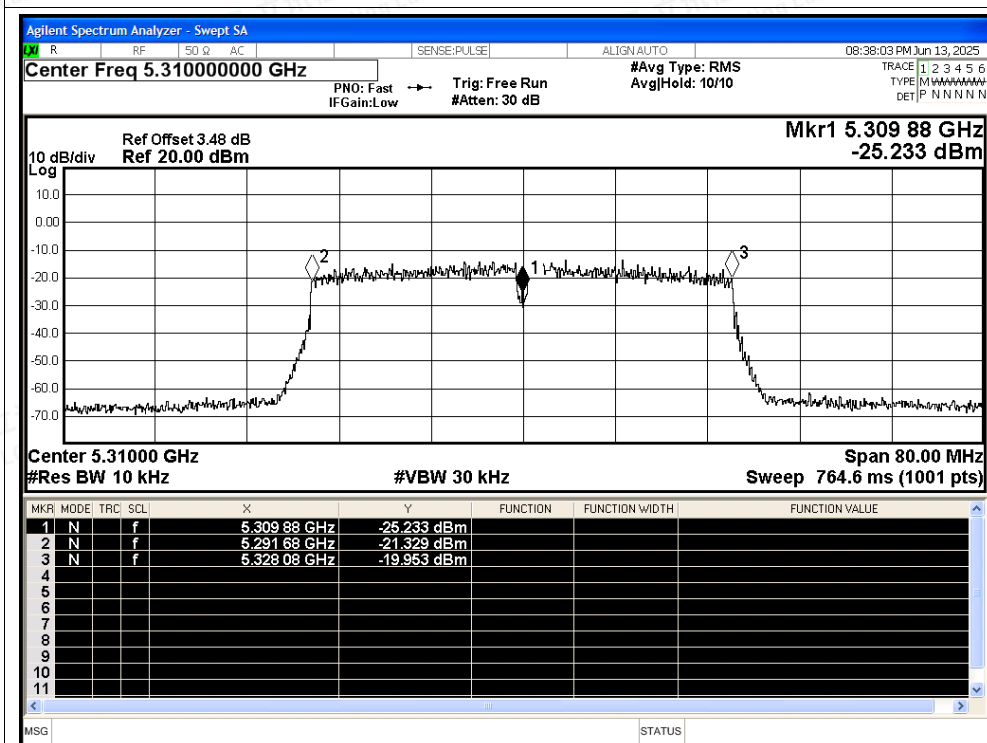

Freq. Stability NVNT ac80 5290MHz Ant1

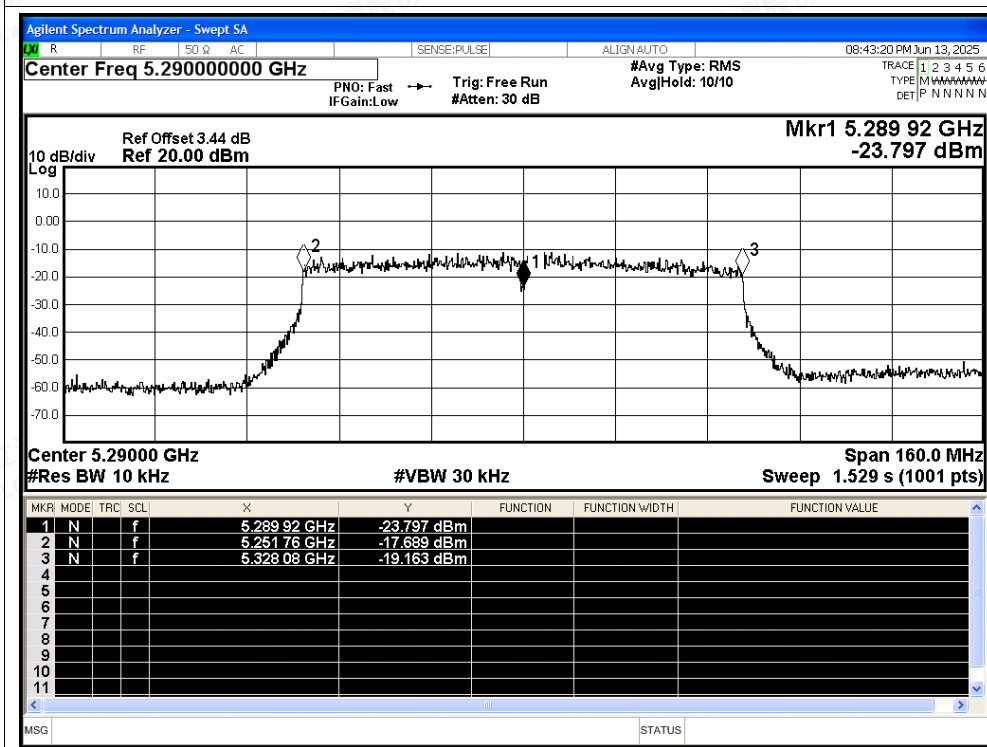

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant1

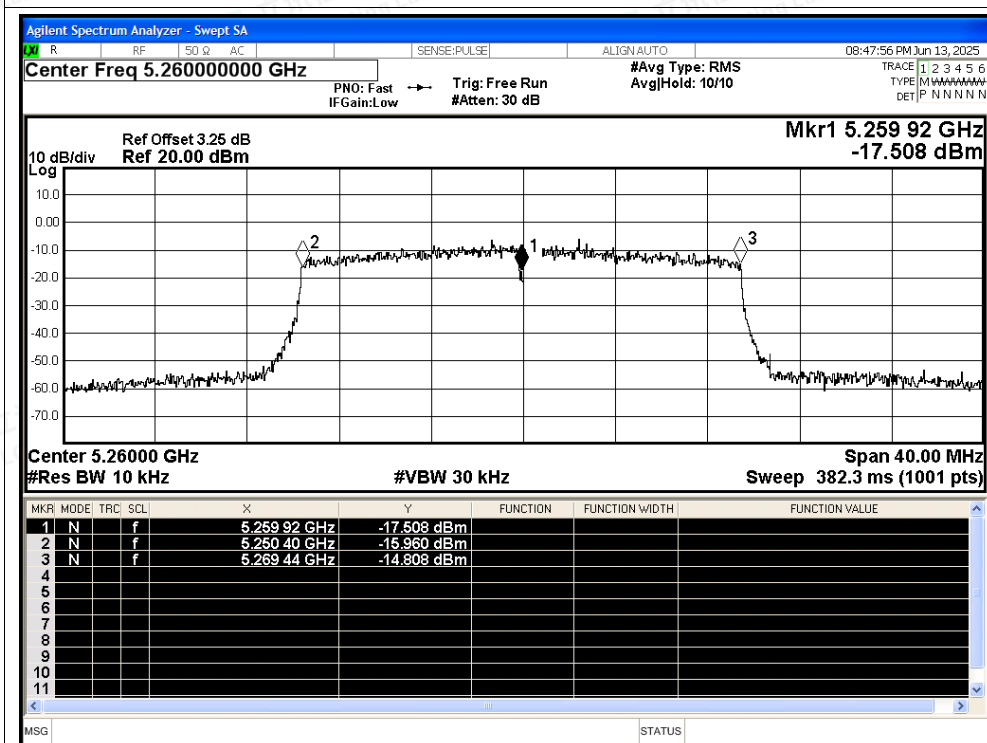

Freq. Stability NVNT ax20 5300MHz Ant1

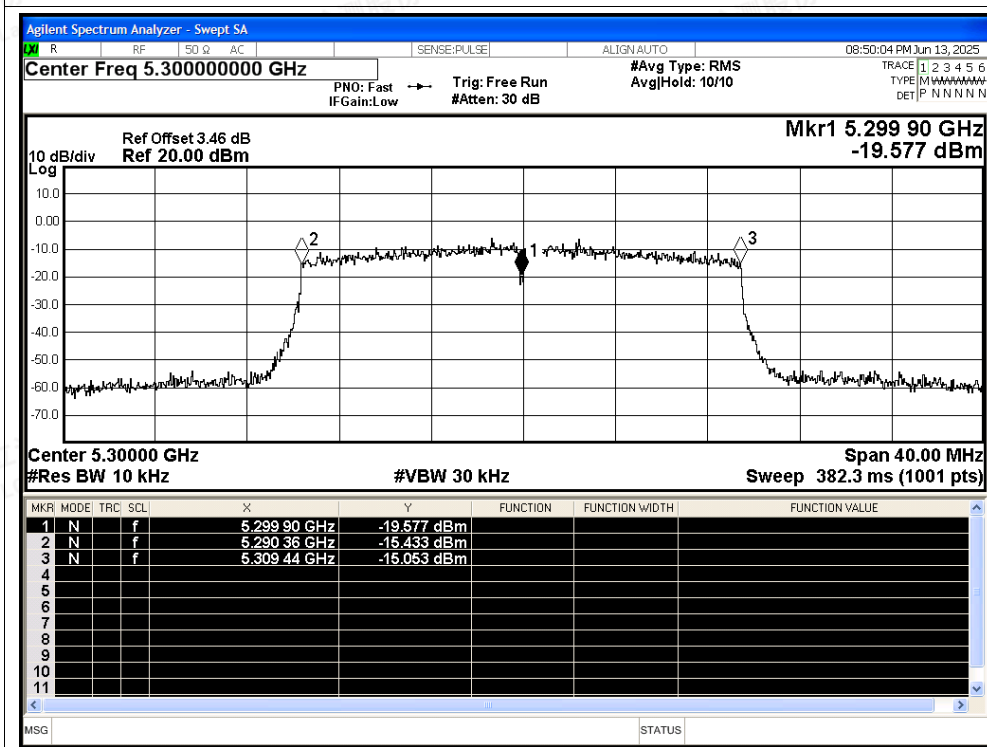

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant1

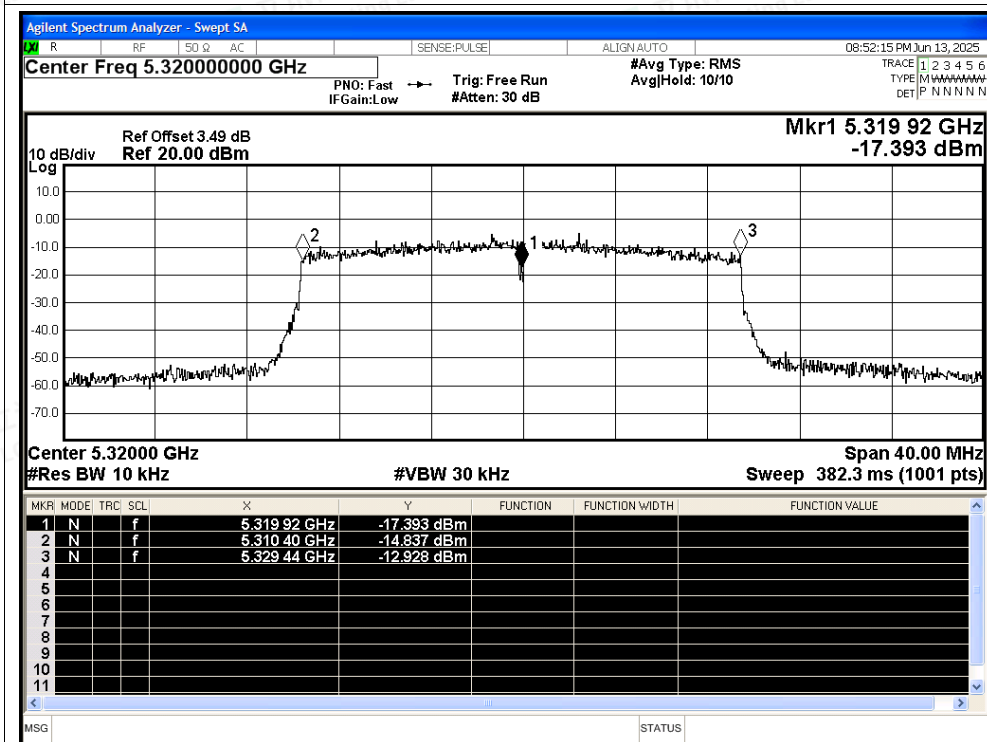

Freq. Stability NVNT ax40 5270MHz Ant1

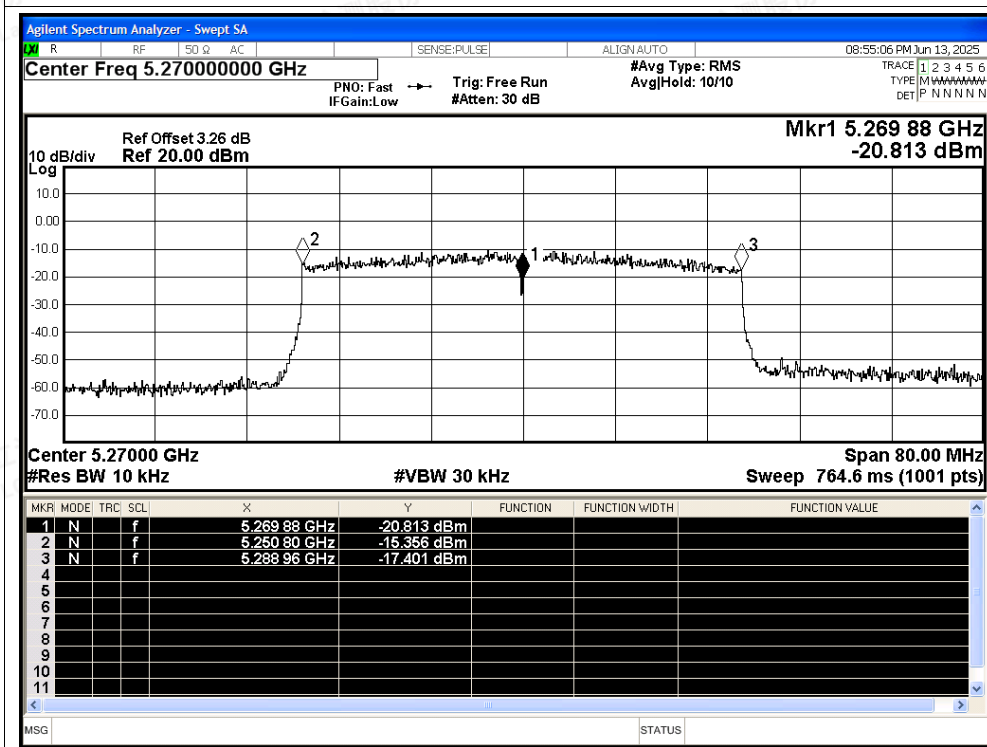

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant1

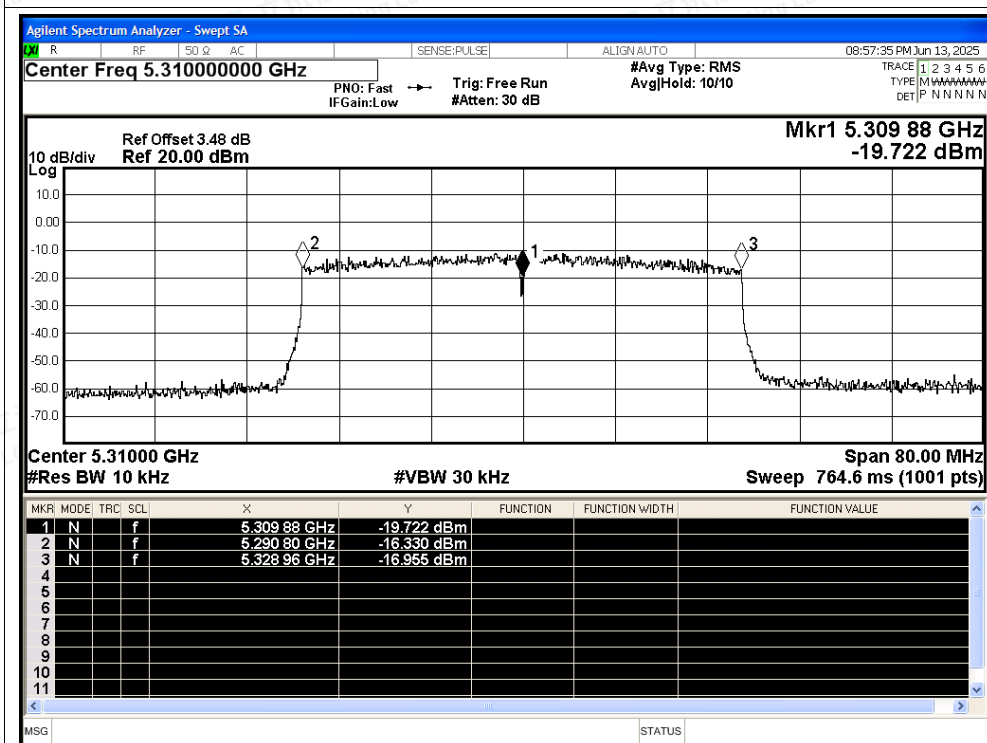

Freq. Stability NVNT ax80 5290MHz Ant1

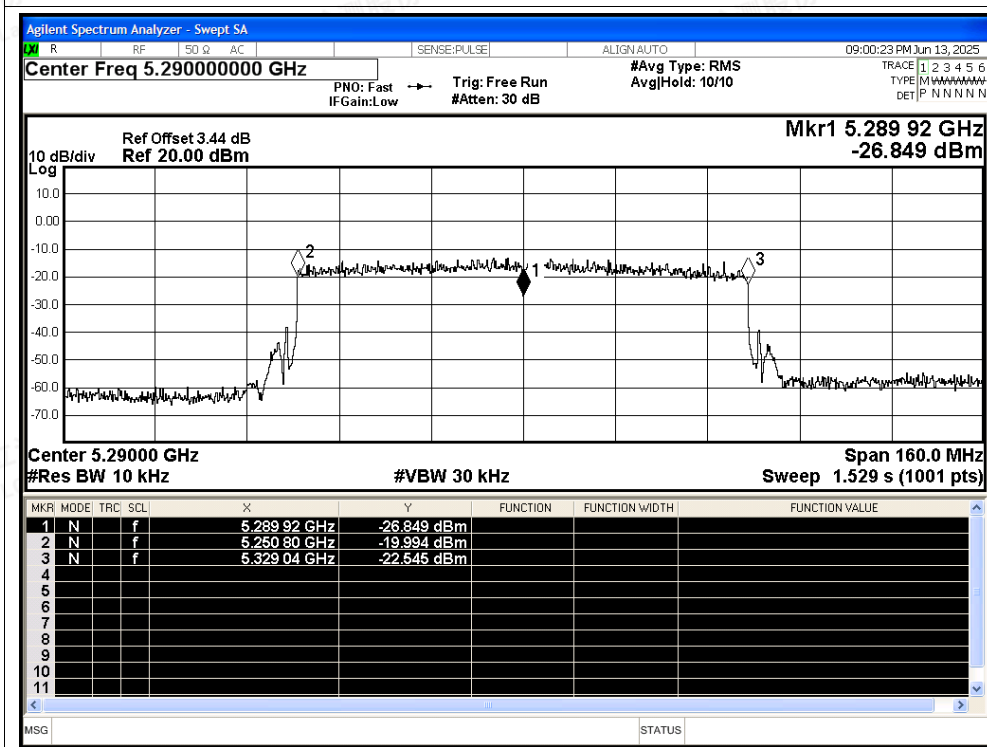

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5260	Ant2	5259.9	-100000	-19.01	25	Pass
NVNT	a	5300	Ant2	5299.9	-100000	-18.87	25	Pass
NVNT	a	5320	Ant2	5319.9	-100000	-18.8	25	Pass
NVNT	n20	5260	Ant2	5259.94	-60000	-11.41	25	Pass
NVNT	n20	5300	Ant2	5299.94	-60000	-11.32	25	Pass
NVNT	n20	5320	Ant2	5319.94	-60000	-11.28	25	Pass
NVNT	n40	5270	Ant2	5269.88	-120000	-22.77	25	Pass
NVNT	n40	5310	Ant2	5309.96	-40000	-7.53	25	Pass
NVNT	ac20	5260	Ant2	5259.92	-80000	-15.21	25	Pass
NVNT	ac20	5300	Ant2	5299.94	-60000	-11.32	25	Pass
NVNT	ac20	5320	Ant2	5319.92	-80000	-15.04	25	Pass
NVNT	ac40	5270	Ant2	5269.92	-80000	-15.18	25	Pass
NVNT	ac40	5310	Ant2	5309.88	-120000	-22.6	25	Pass
NVNT	ac80	5290	Ant2	5289.92	-80000	-15.12	25	Pass
NVNT	ax20	5260	Ant2	5259.92	-80000	-15.21	25	Pass
NVNT	ax20	5300	Ant2	5299.92	-80000	-15.09	25	Pass
NVNT	ax20	5320	Ant2	5319.92	-80000	-15.04	25	Pass
NVNT	ax40	5270	Ant2	5269.88	-120000	-22.77	25	Pass
NVNT	ax40	5310	Ant2	5309.88	-120000	-22.6	25	Pass
NVNT	ax80	5290	Ant2	5289.92	-80000	-15.12	25	Pass






Test Graphs

Freq. Stability NVNT a 5260MHz Ant2

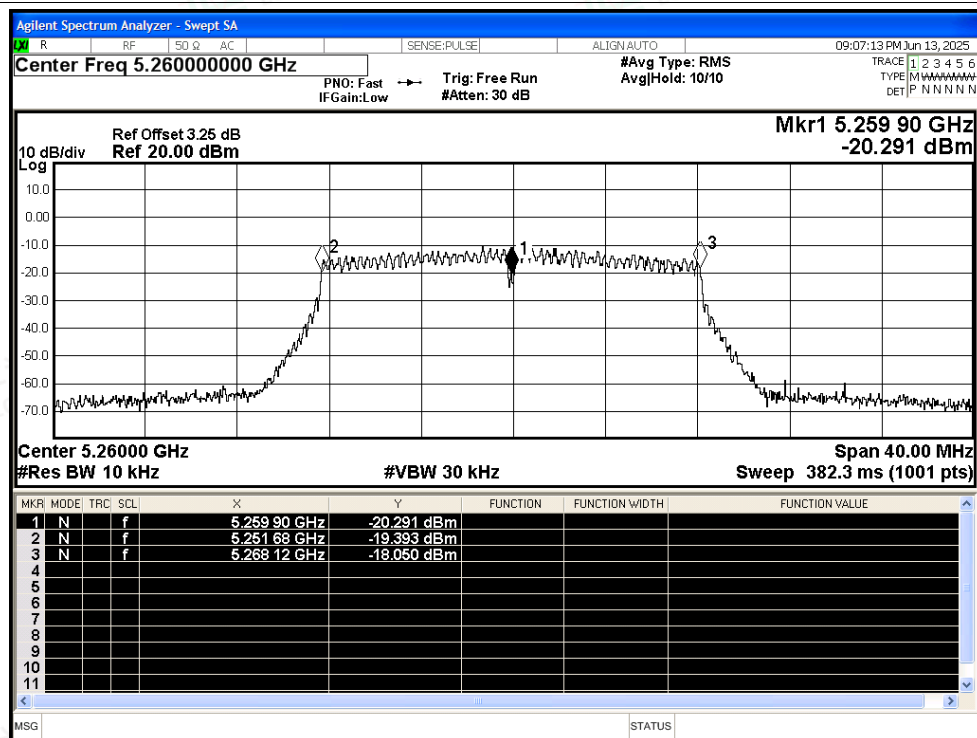

Freq. Stability NVNT a 5300MHz Ant2

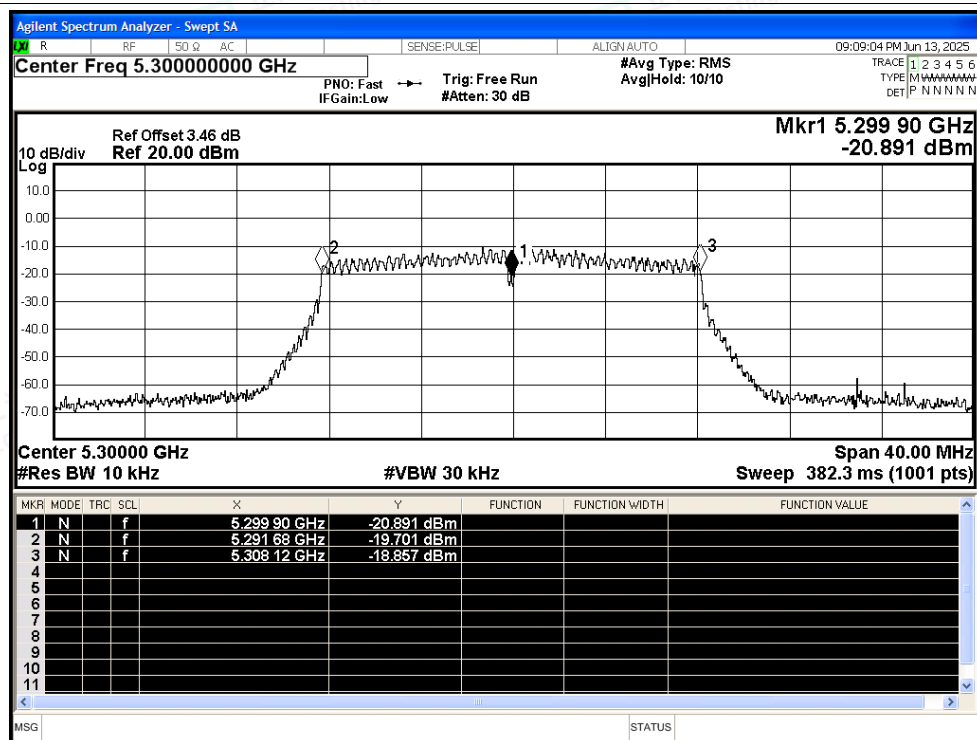

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5320MHz Ant2

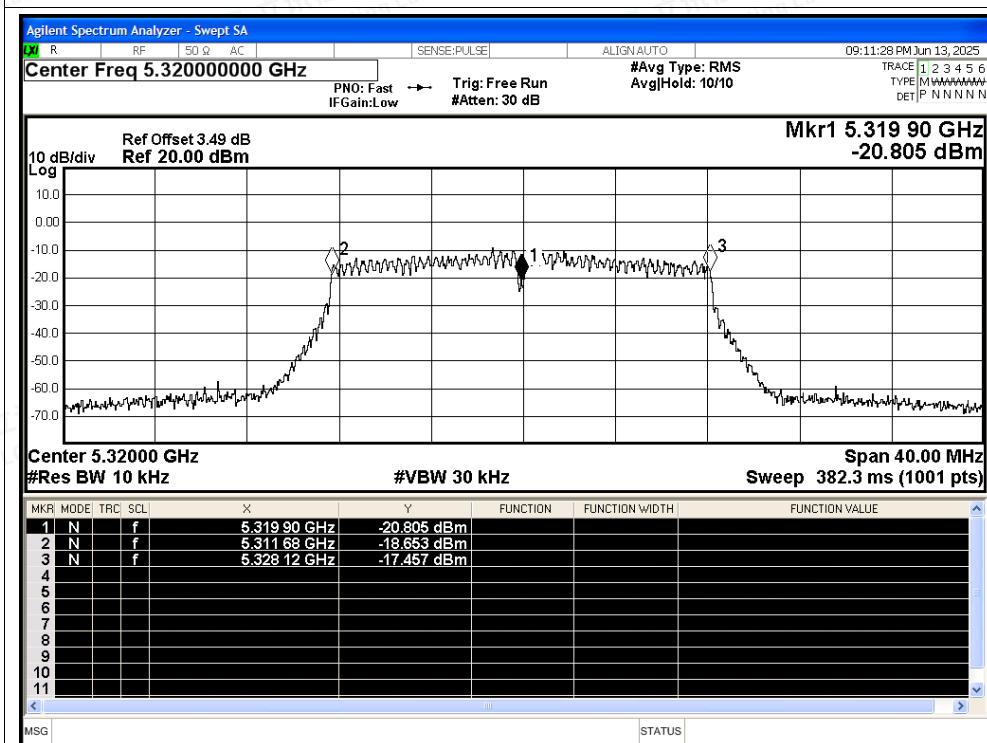

Freq. Stability NVNT n20 5260MHz Ant2

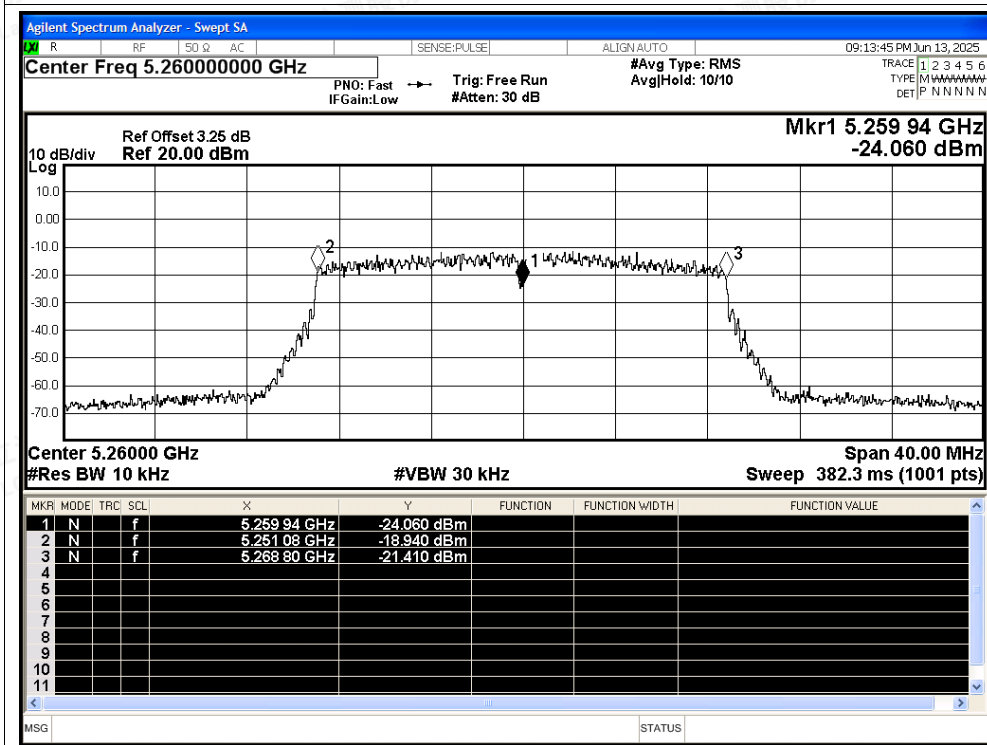

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5300MHz Ant2

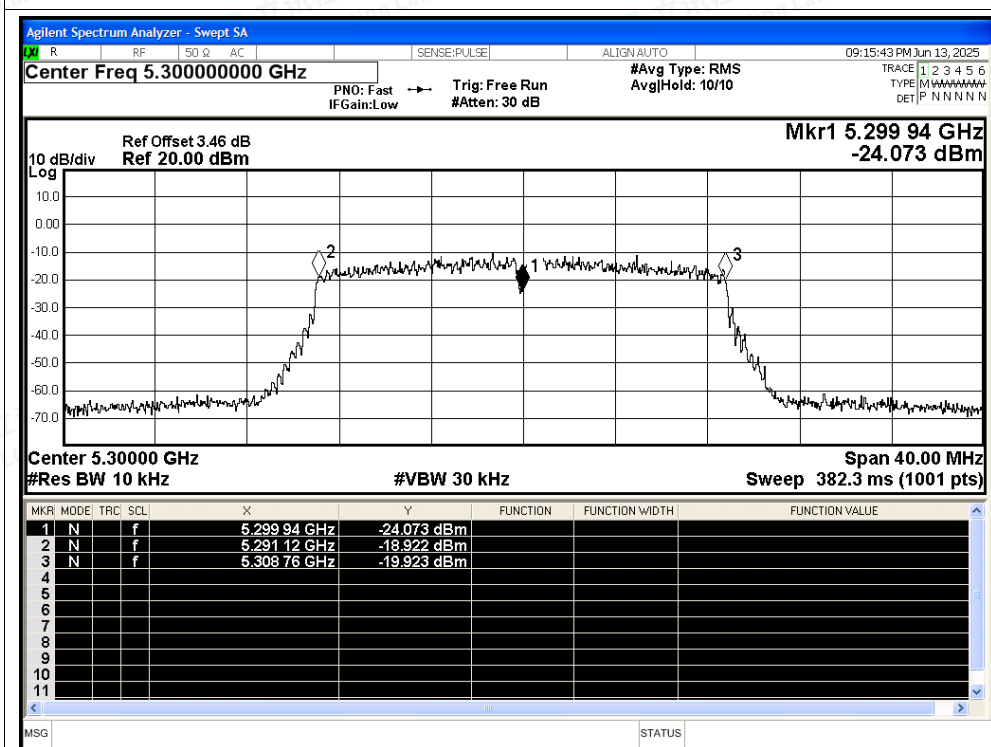

Freq. Stability NVNT n20 5320MHz Ant2

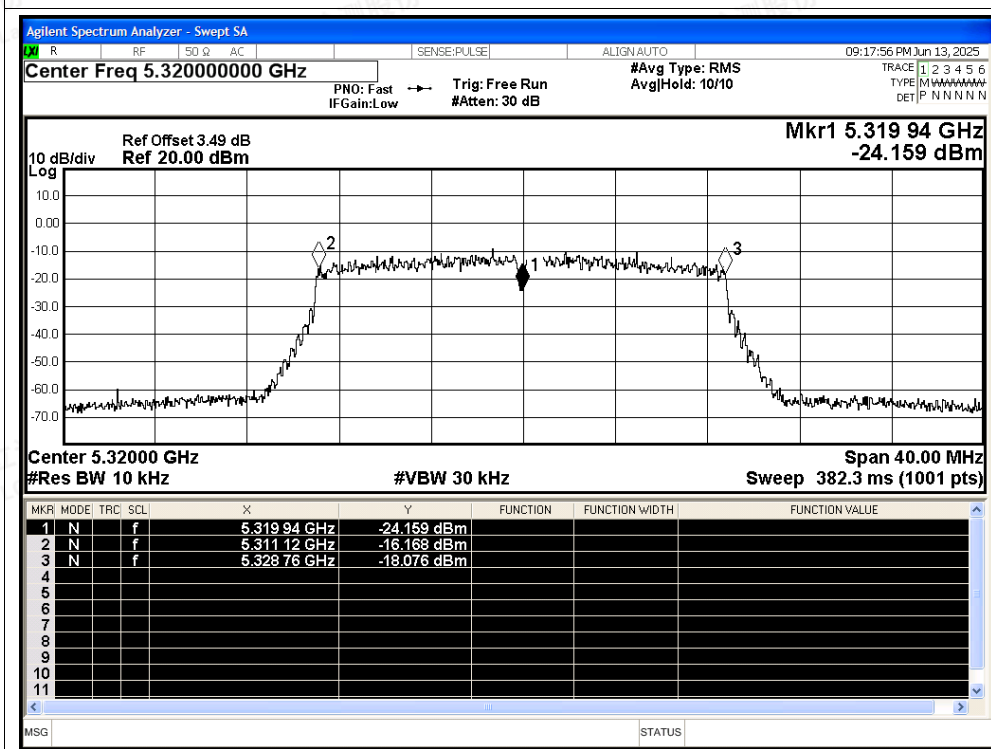

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5270MHz Ant2

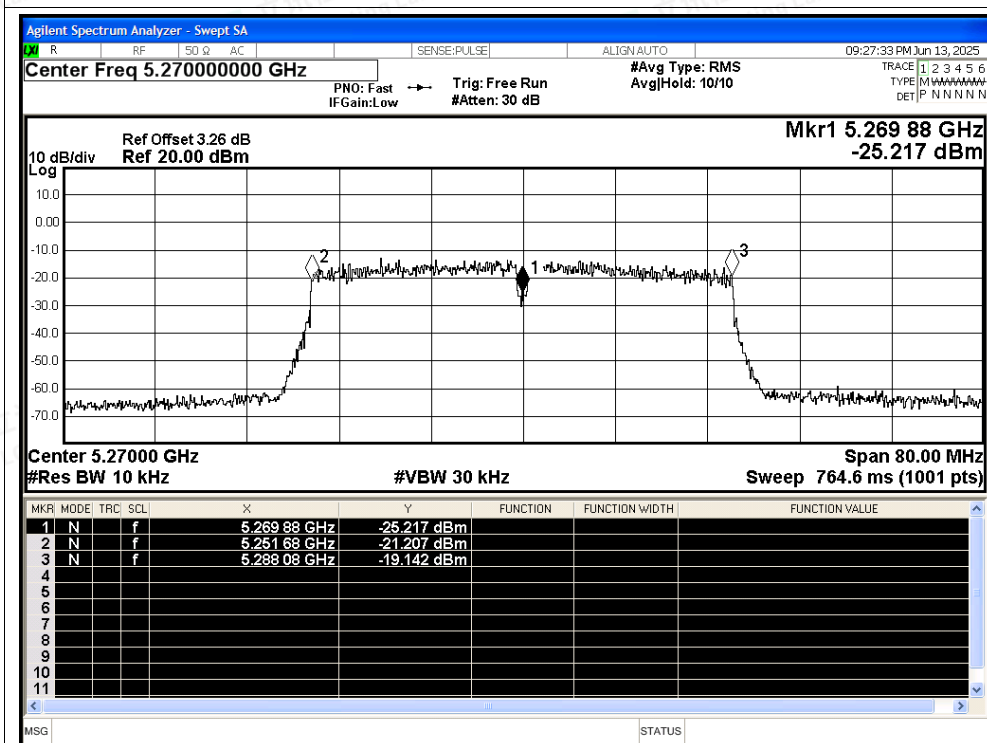

Freq. Stability NVNT n40 5310MHz Ant2

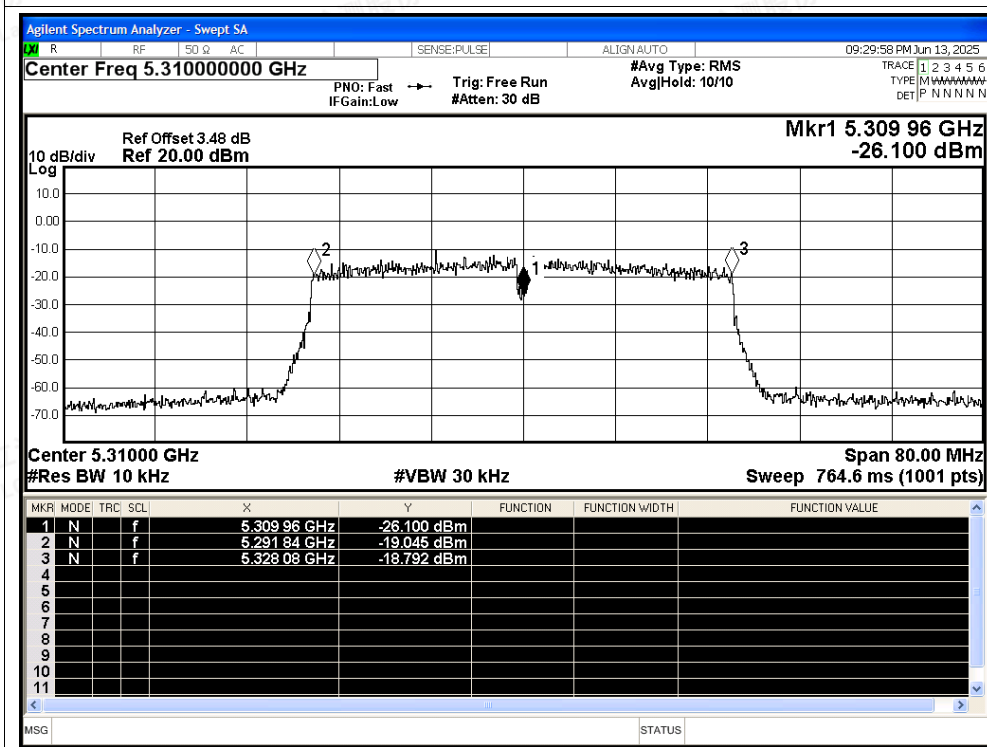

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5260MHz Ant2

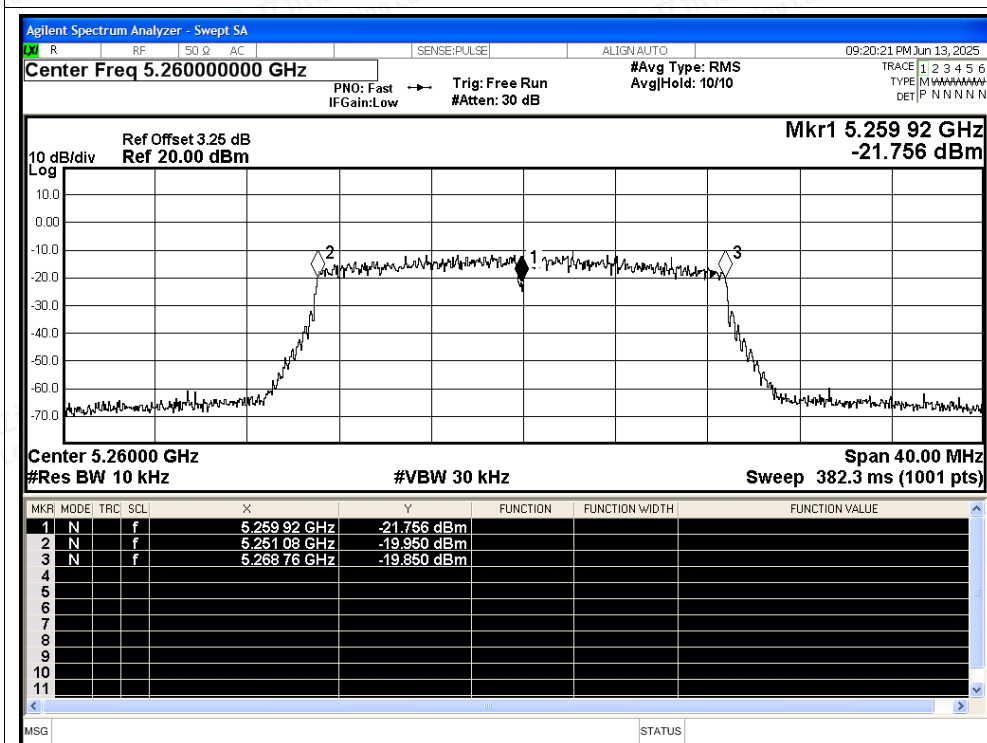

Freq. Stability NVNT ac20 5300MHz Ant2

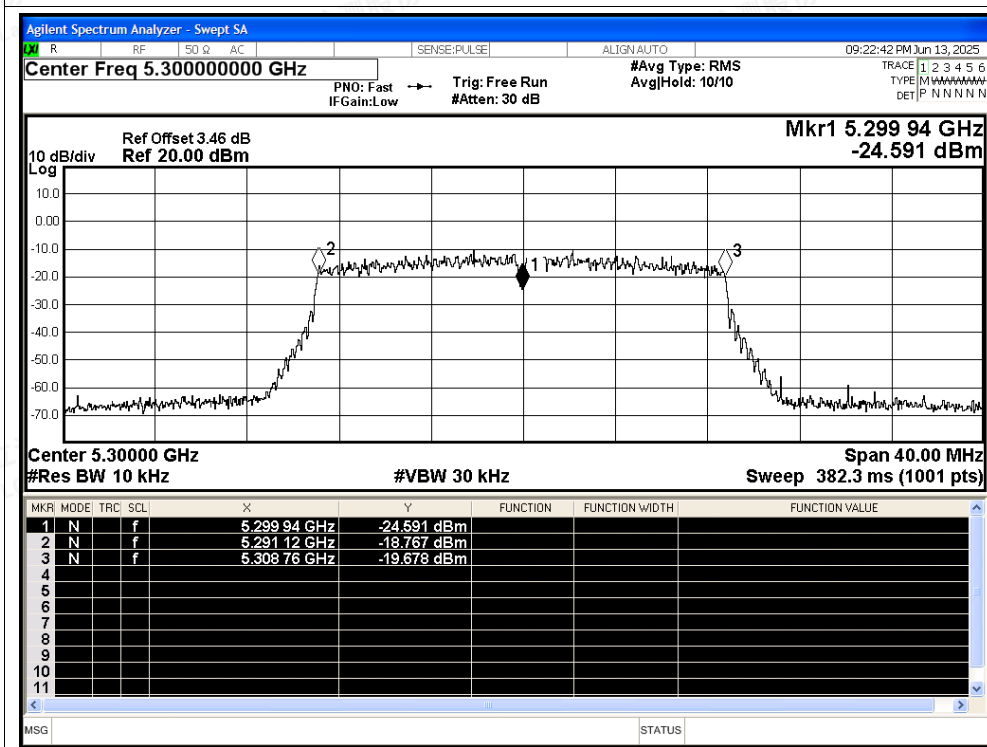

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5320MHz Ant2

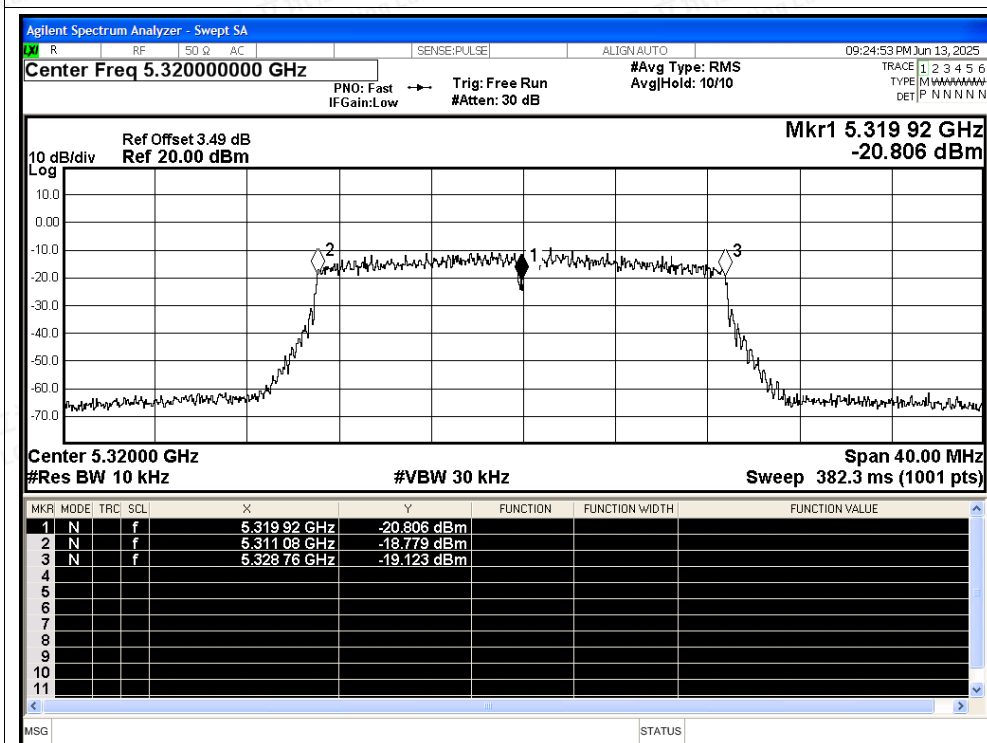

Freq. Stability NVNT ac40 5270MHz Ant2

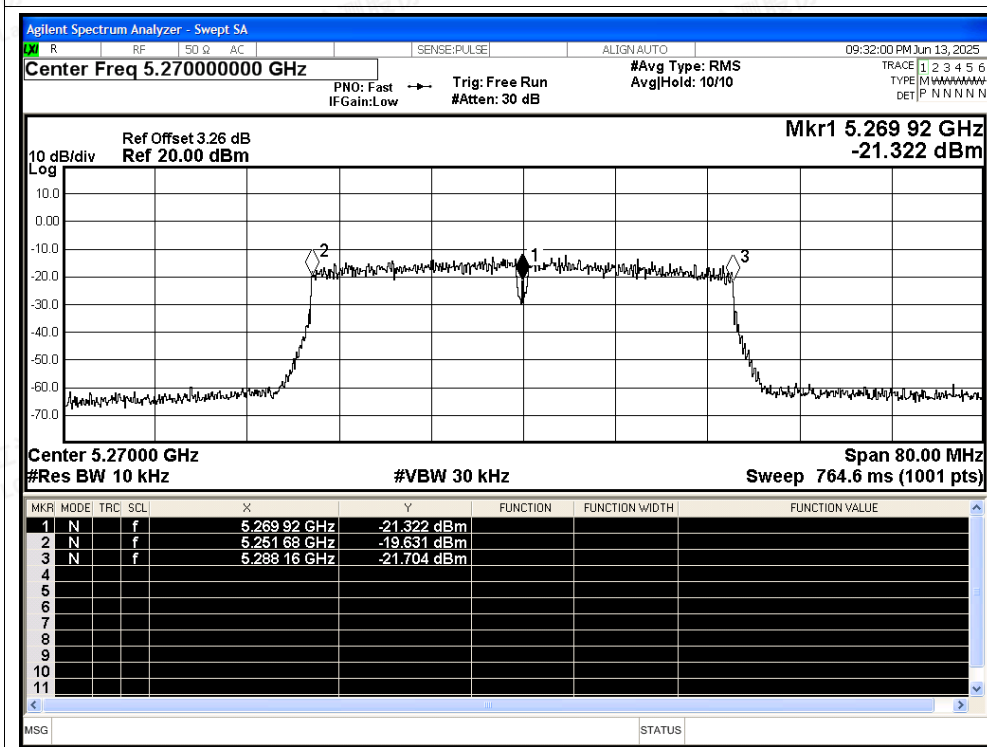

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5310MHz Ant2

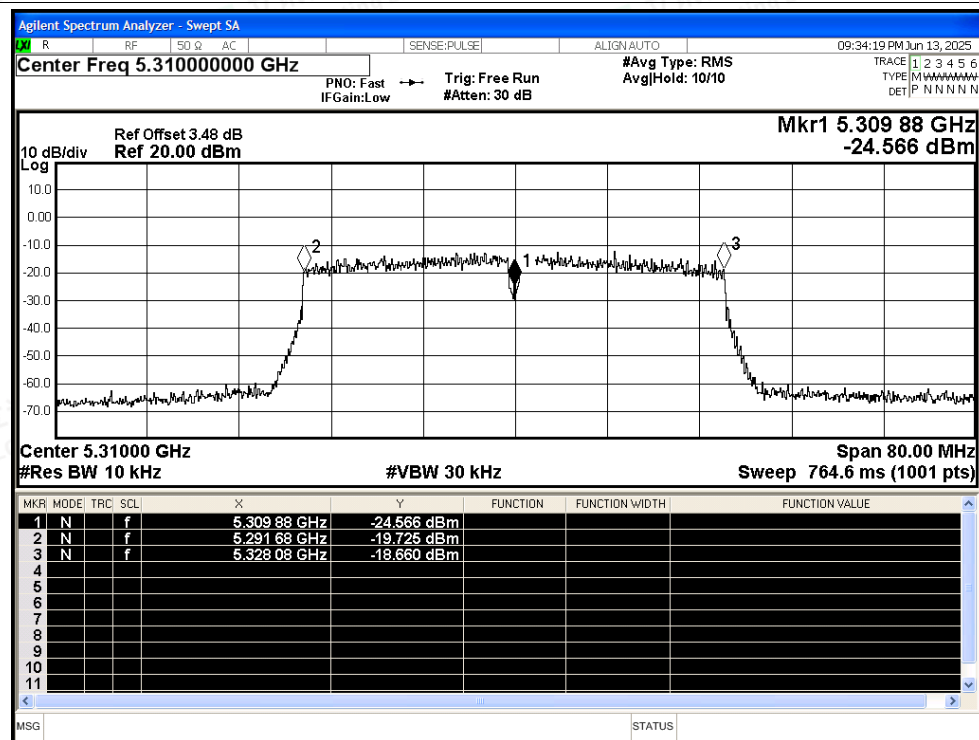

Freq. Stability NVNT ac80 5290MHz Ant2

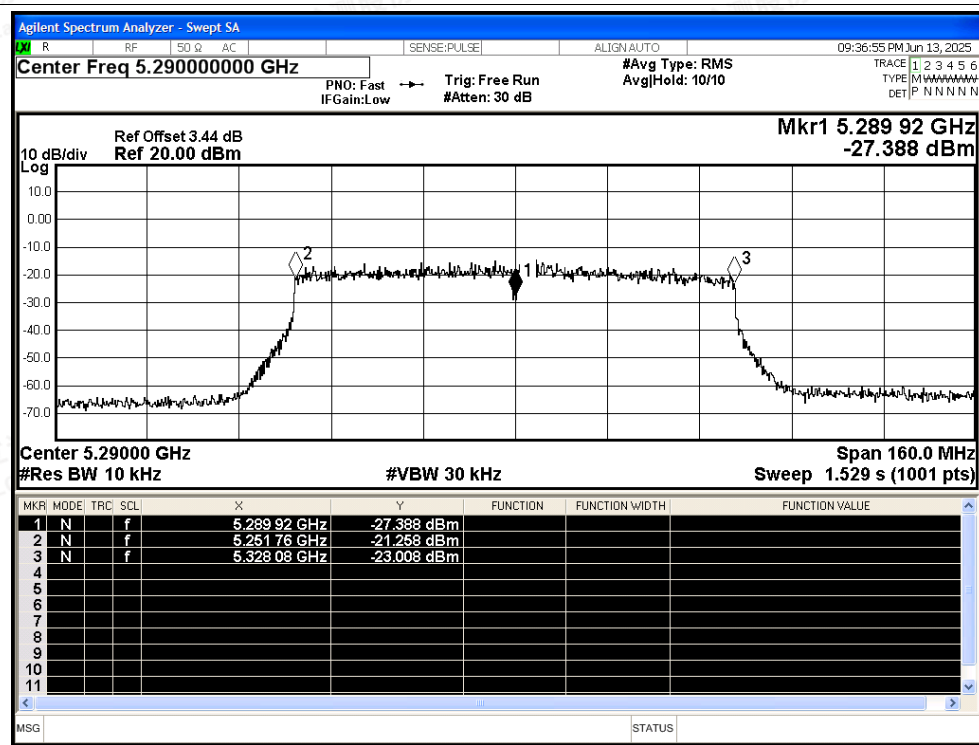

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5260MHz Ant2

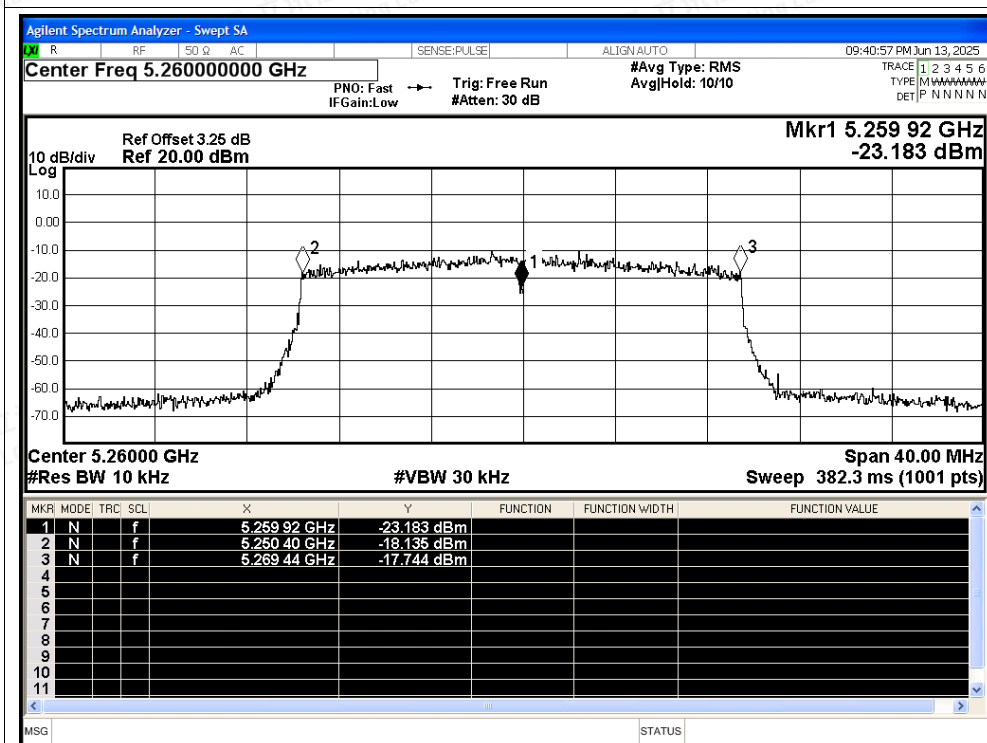

Freq. Stability NVNT ax20 5300MHz Ant2

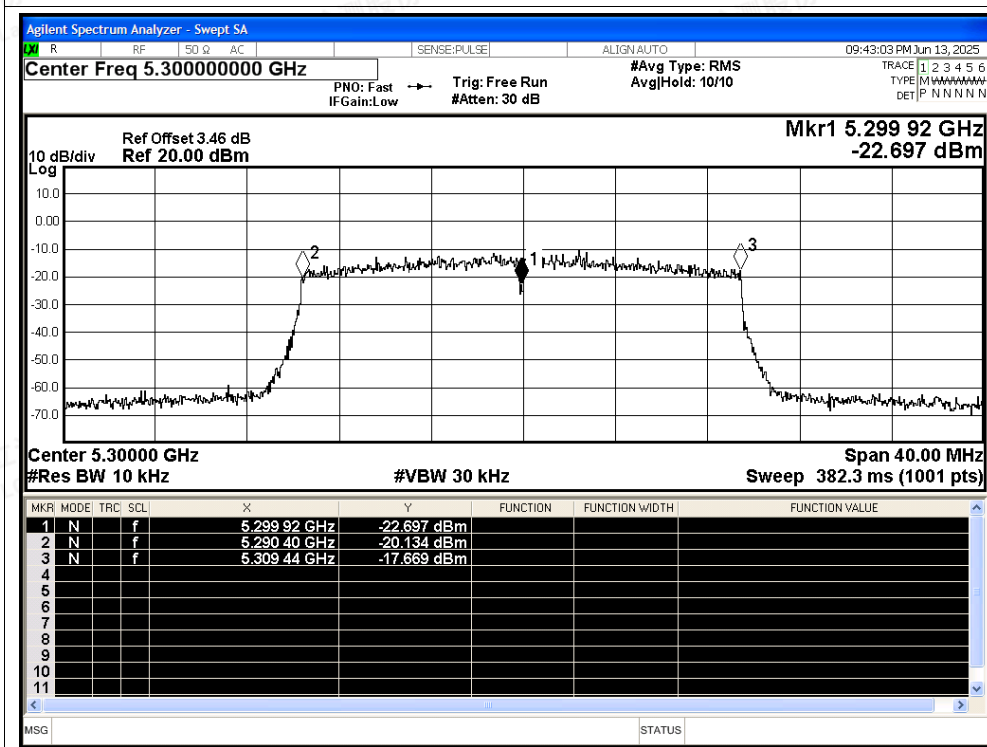

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5320MHz Ant2

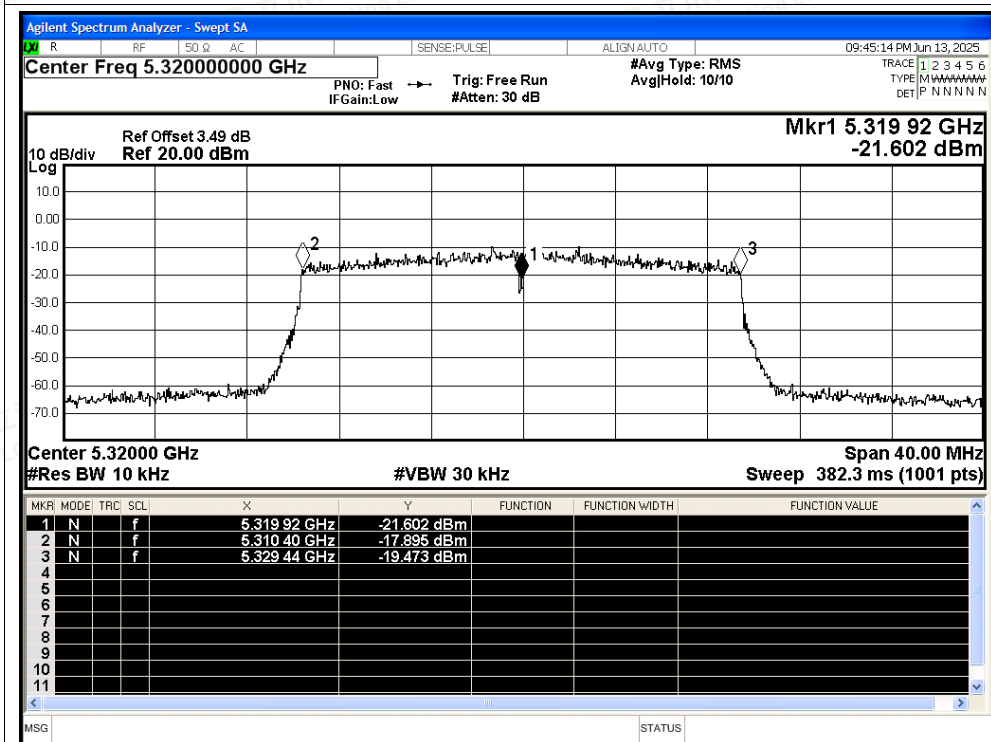

Freq. Stability NVNT ax40 5270MHz Ant2

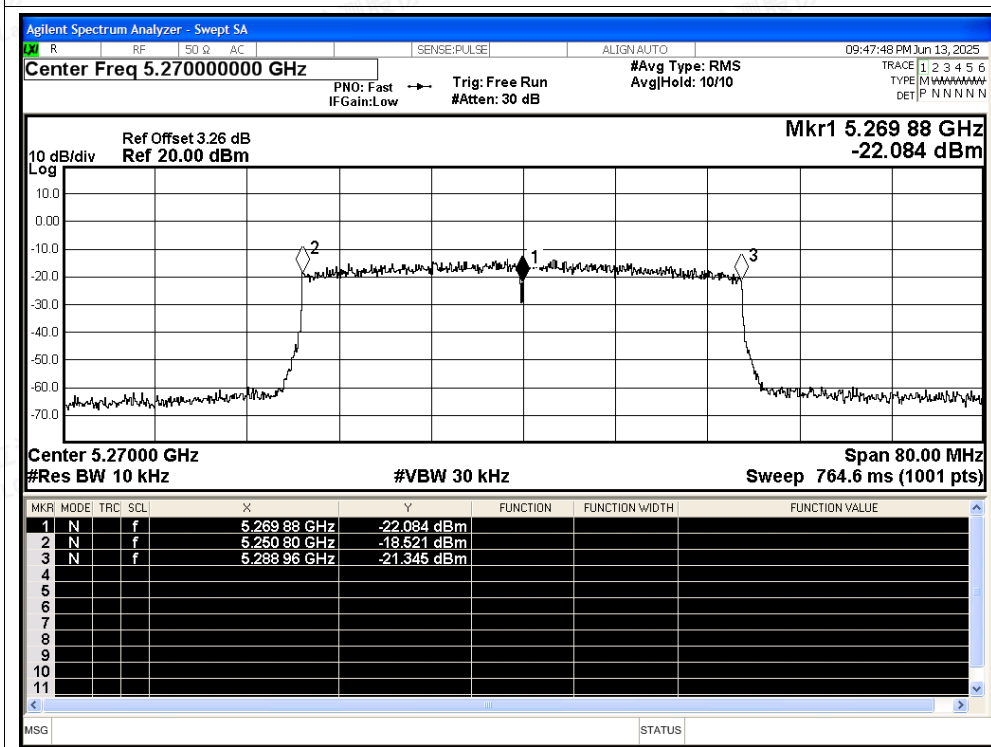

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5310MHz Ant2

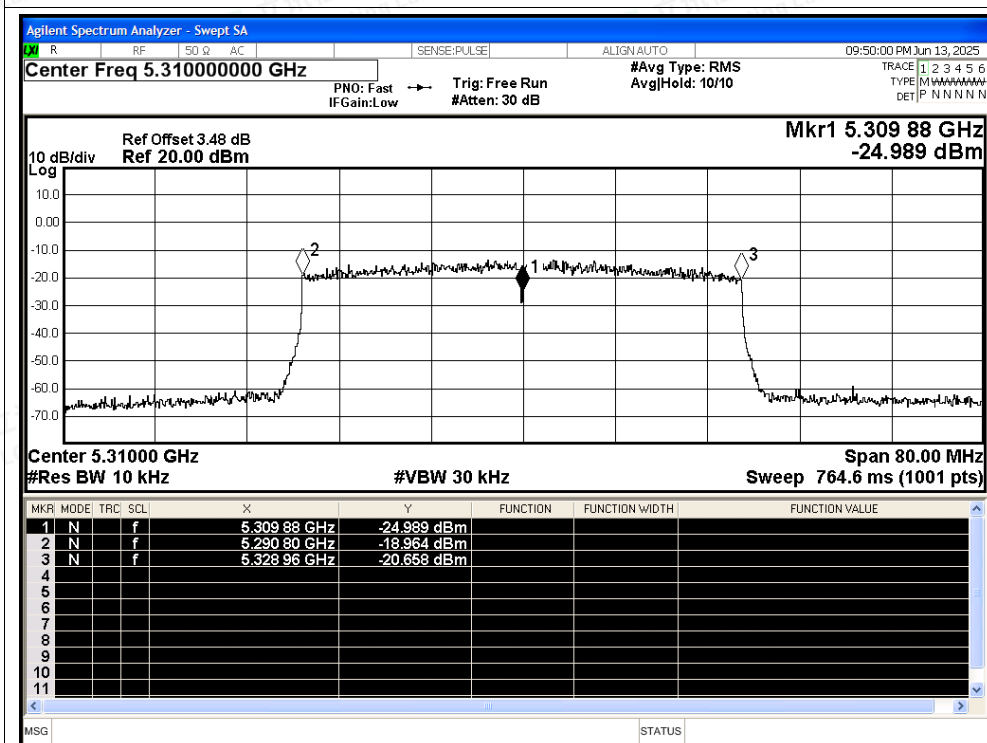

Freq. Stability NVNT ax80 5290MHz Ant2

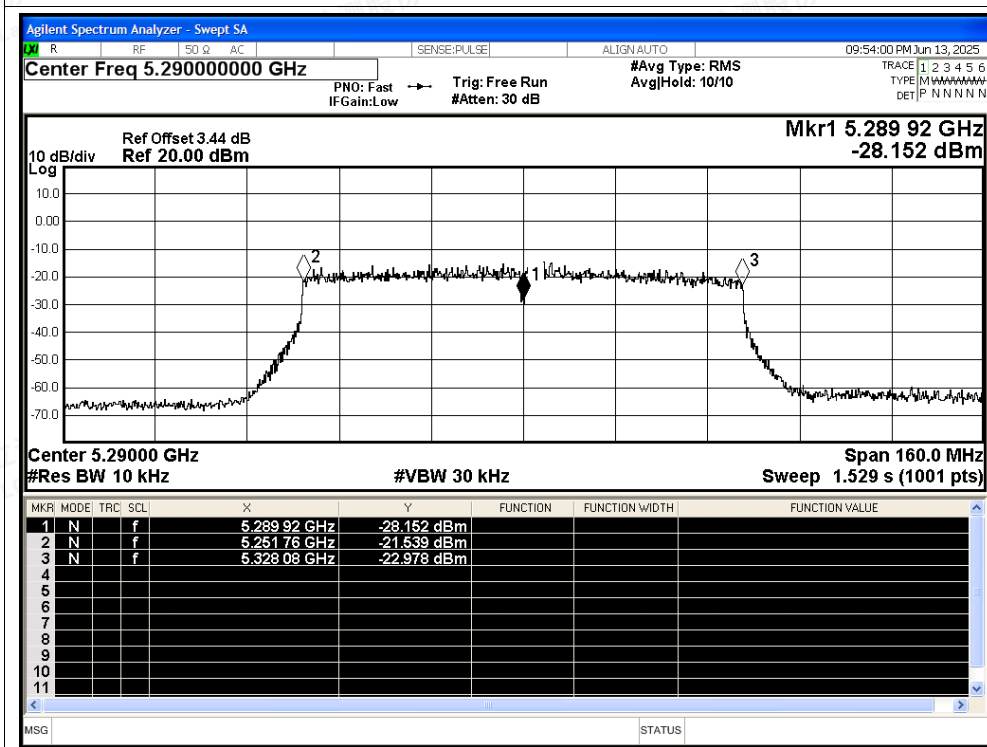

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



E.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5260	Ant1	93.02	0.31	0.74
NVNT	a	5300	Ant1	93.09	0.31	0.73
NVNT	a	5320	Ant1	93.02	0.31	0.74
NVNT	n20	5260	Ant1	91.85	0.37	0.87
NVNT	n20	5300	Ant1	91.93	0.37	0.87
NVNT	n20	5320	Ant1	91.85	0.37	0.87
NVNT	n40	5270	Ant1	85.01	0.71	1.75
NVNT	n40	5310	Ant1	84.89	0.71	1.75
NVNT	ac20	5260	Ant1	91.87	0.37	0.87
NVNT	ac20	5300	Ant1	91.87	0.37	0.87
NVNT	ac20	5320	Ant1	91.87	0.37	0.87
NVNT	ac40	5270	Ant1	84.98	0.71	1.73
NVNT	ac40	5310	Ant1	64.58	1.9	5.38
NVNT	ac80	5290	Ant1	73.91	1.31	3.46
NVNT	ax20	5260	Ant1	90.63	0.43	1.01
NVNT	ax20	5300	Ant1	90.63	0.43	1.01
NVNT	ax20	5320	Ant1	90.73	0.42	1.01
NVNT	ax40	5270	Ant1	83.76	0.77	1.92
NVNT	ax40	5310	Ant1	83.6	0.78	1.92
NVNT	ax80	5290	Ant1	73.3	1.35	3.57



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5260MHz Ant1

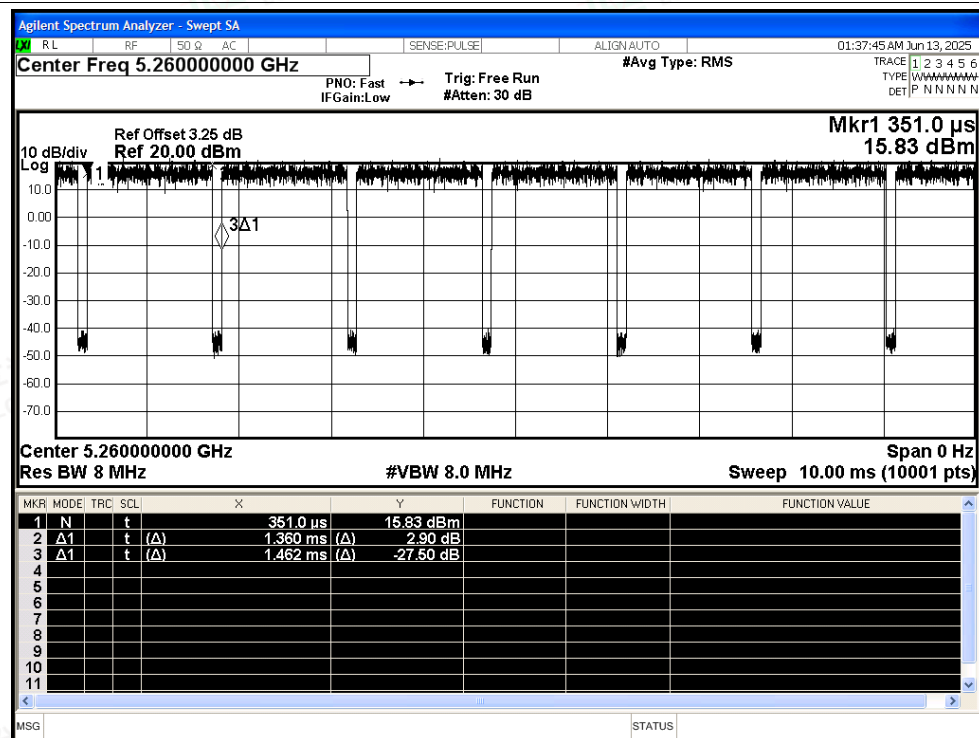

Duty Cycle NVNT a 5300MHz Ant1

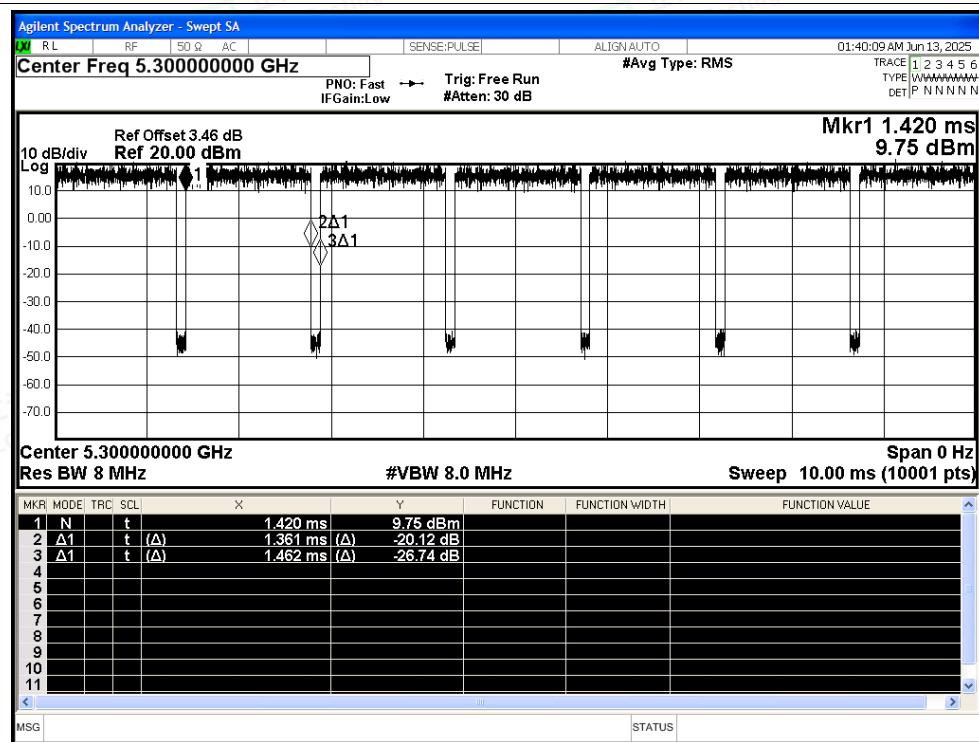

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5320MHz Ant1

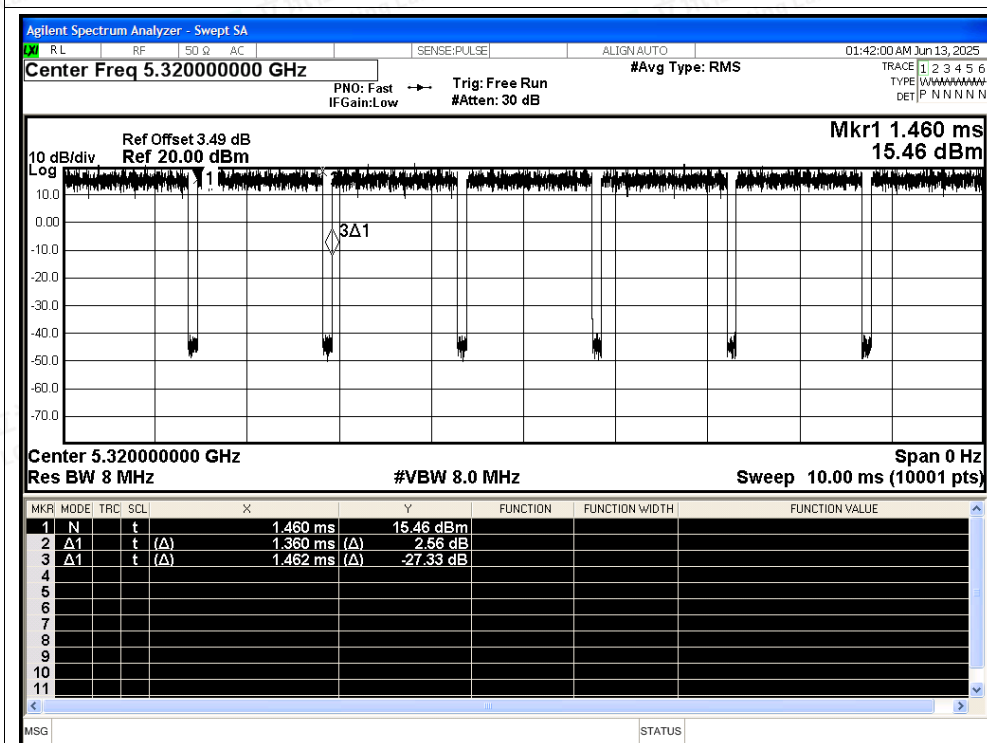

Duty Cycle NVNT n20 5260MHz Ant1

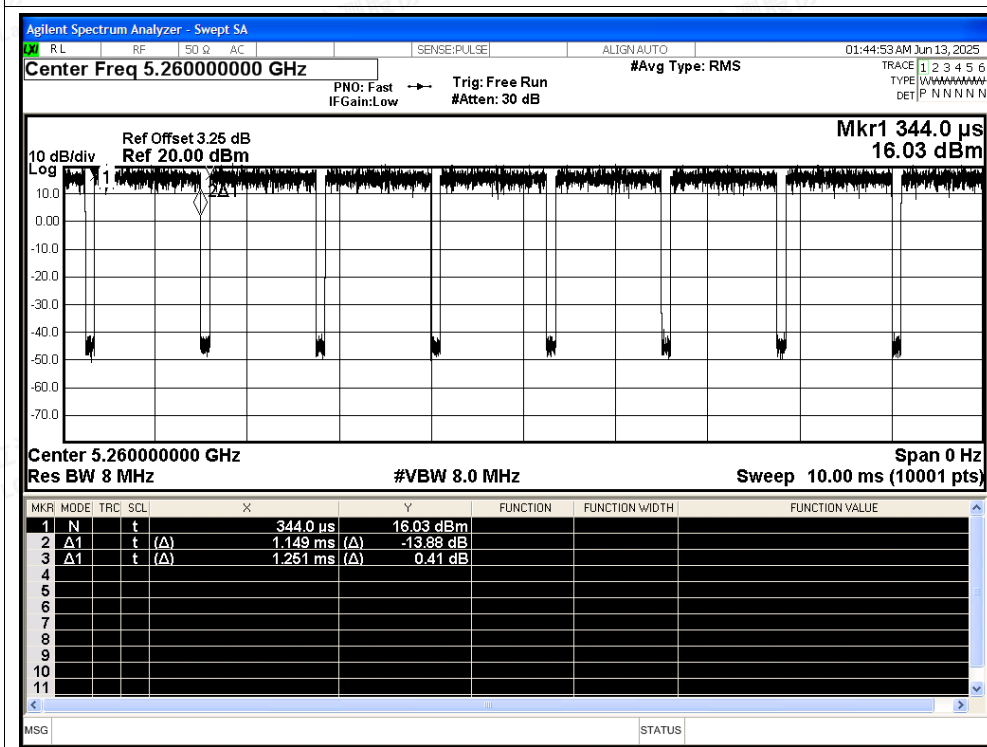

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5300MHz Ant1

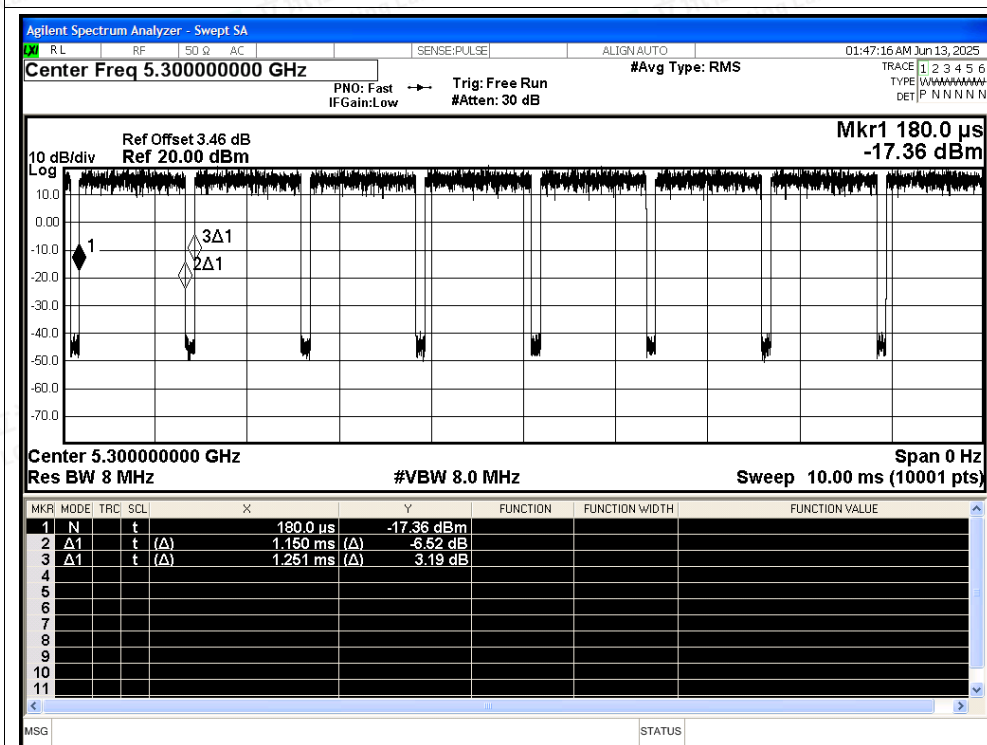

Duty Cycle NVNT n20 5320MHz Ant1

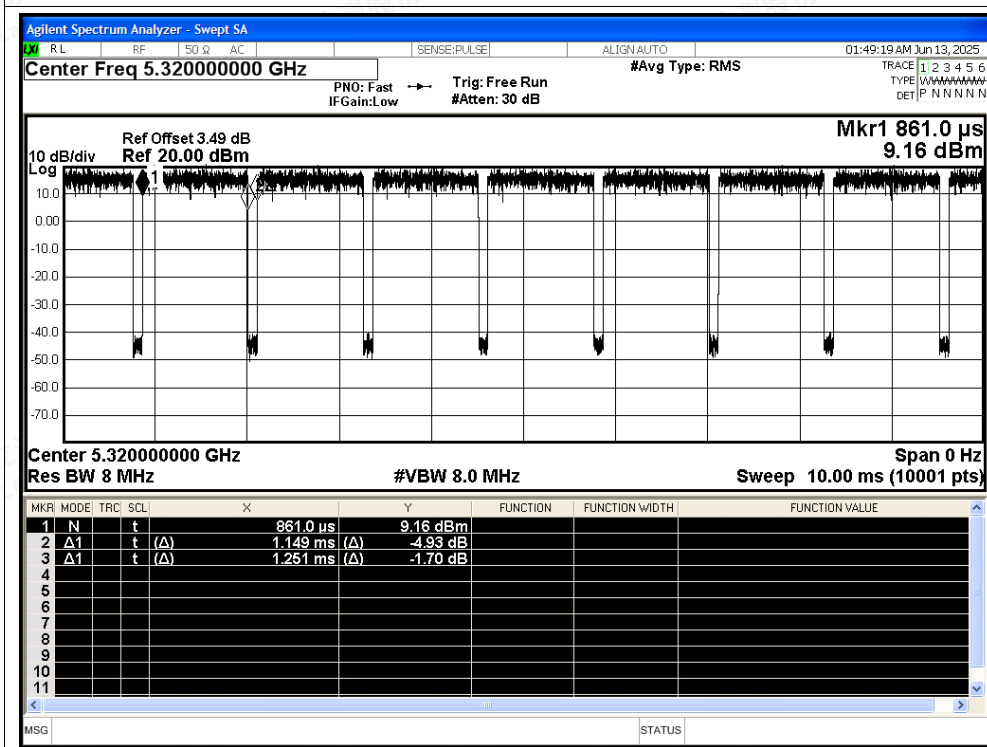

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5270MHz Ant1

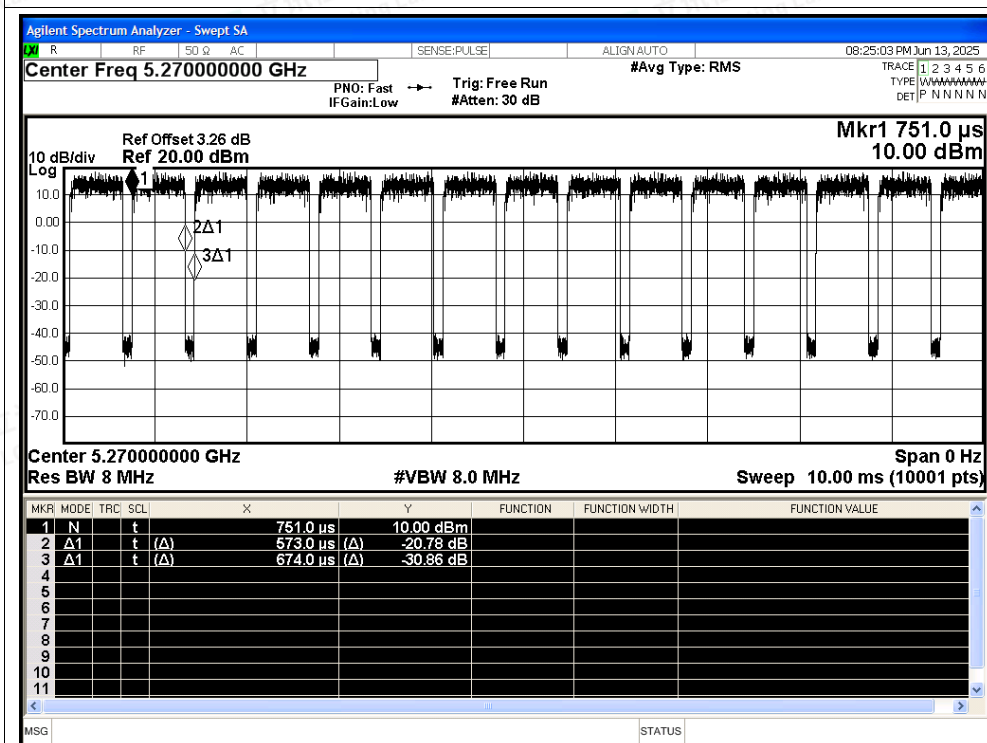

Duty Cycle NVNT n40 5310MHz Ant1

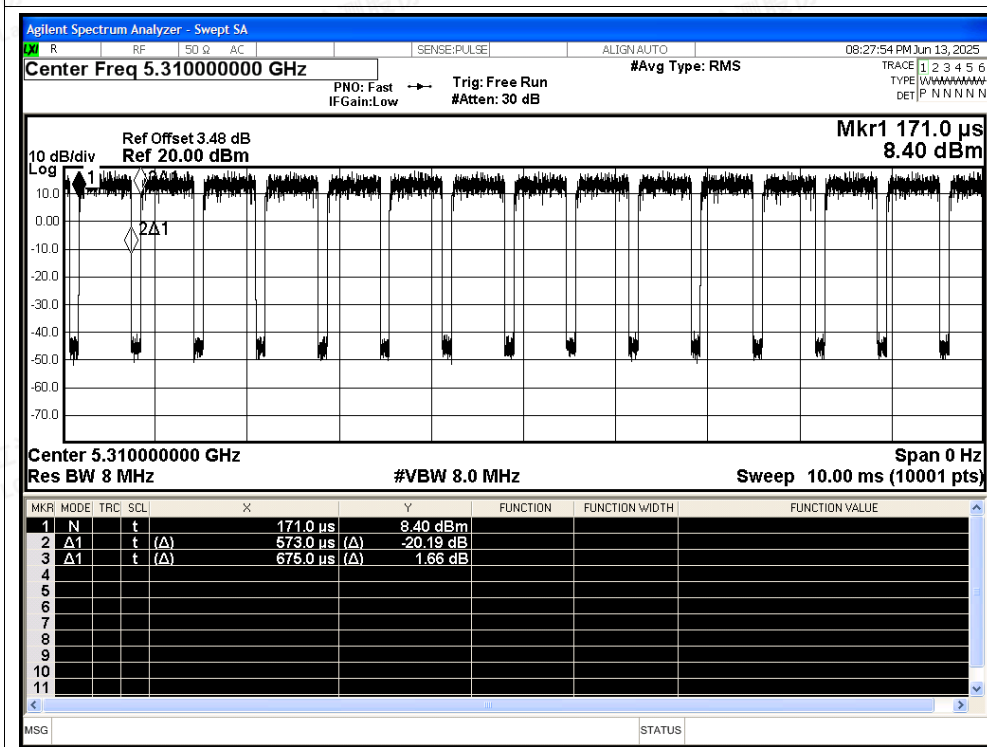

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5260MHz Ant1

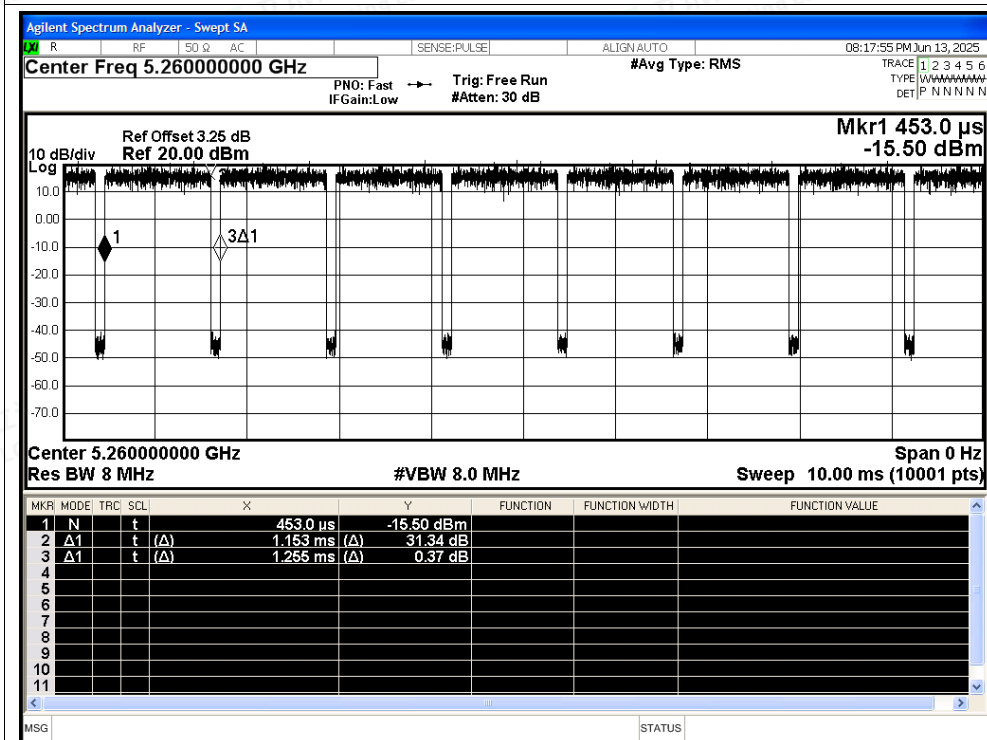

Duty Cycle NVNT ac20 5300MHz Ant1

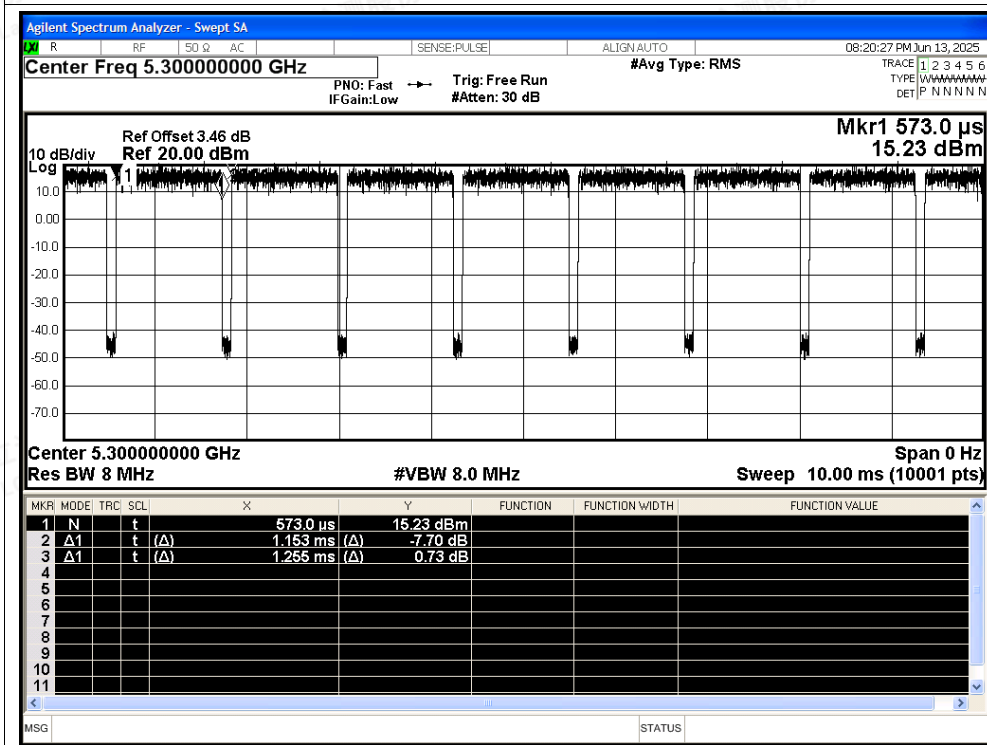

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5320MHz Ant1

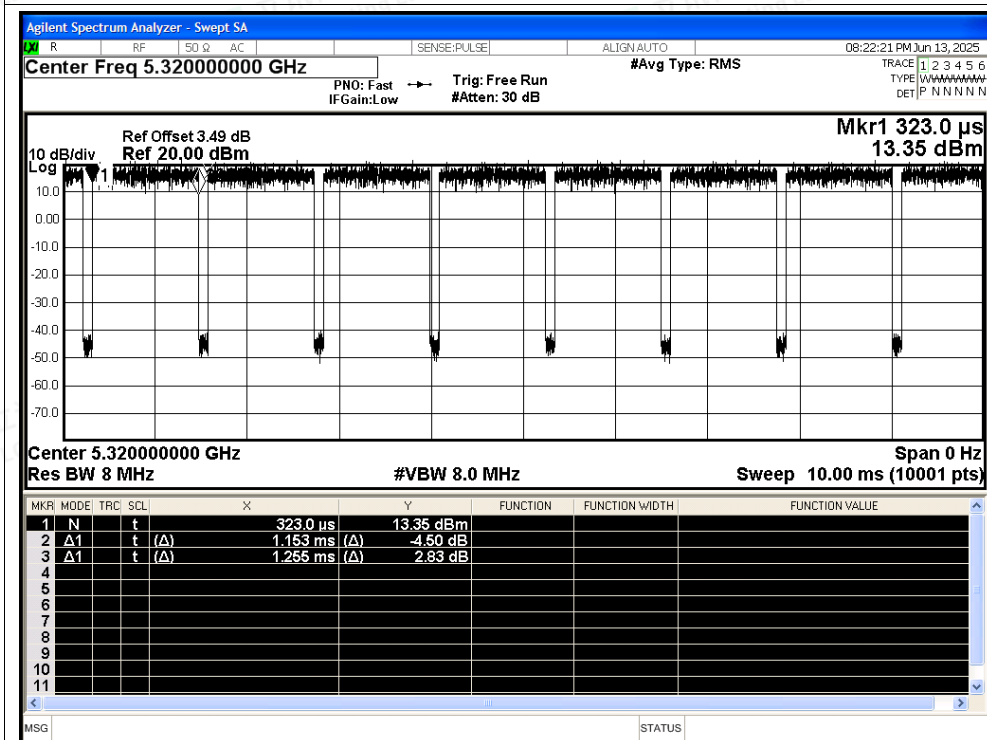

Duty Cycle NVNT ac40 5270MHz Ant1

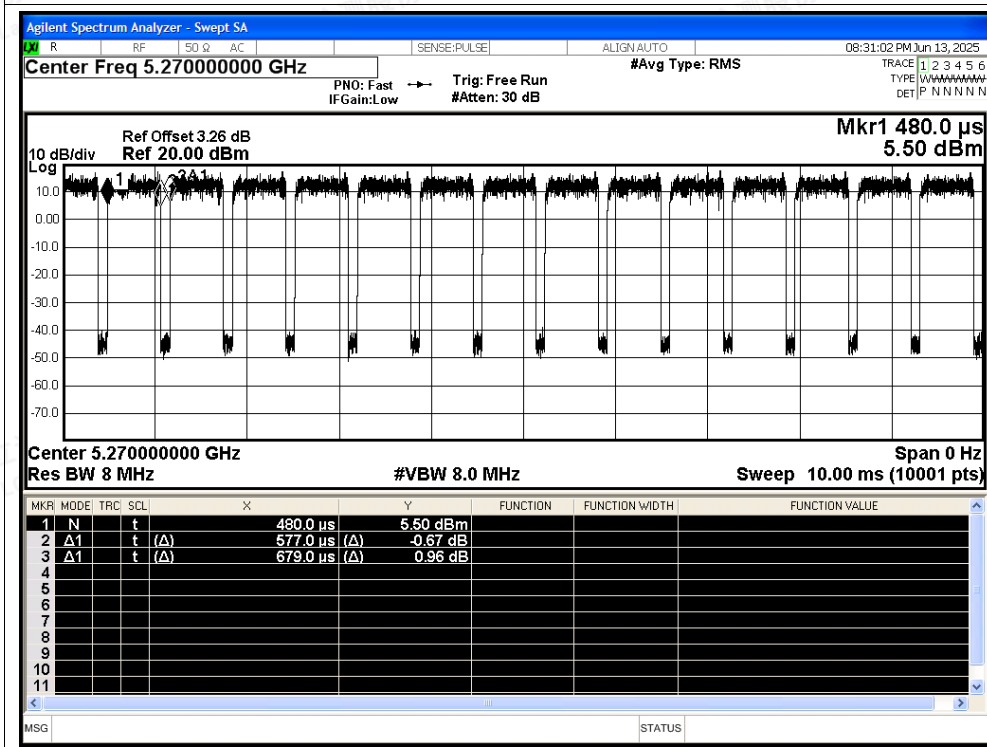

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5310MHz Ant1

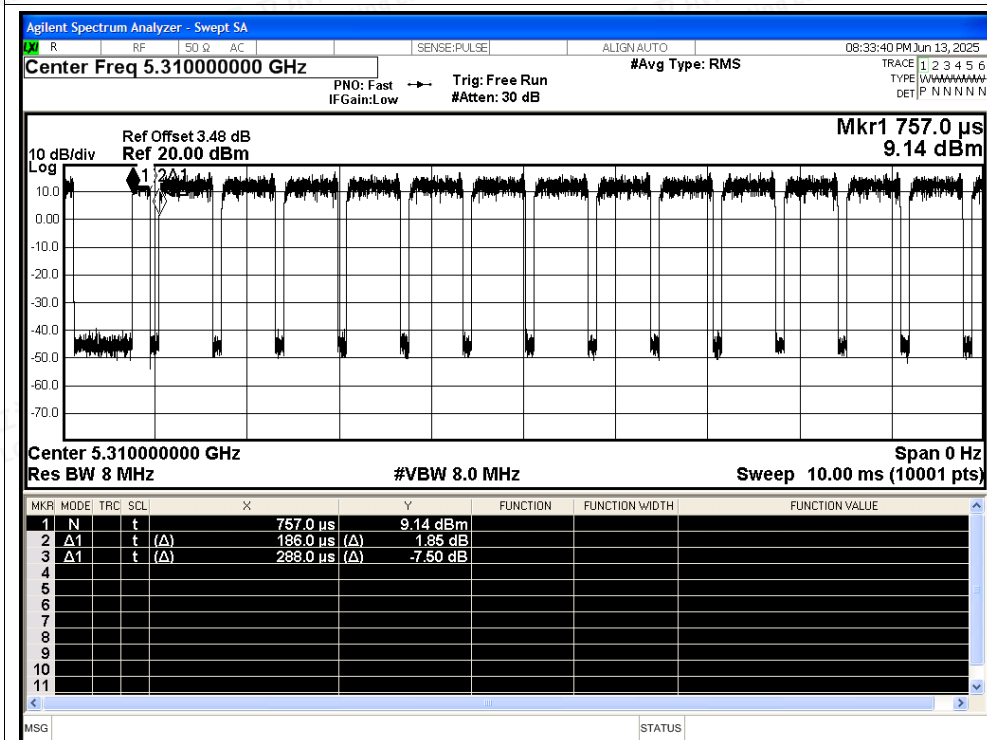

Duty Cycle NVNT ac80 5290MHz Ant1

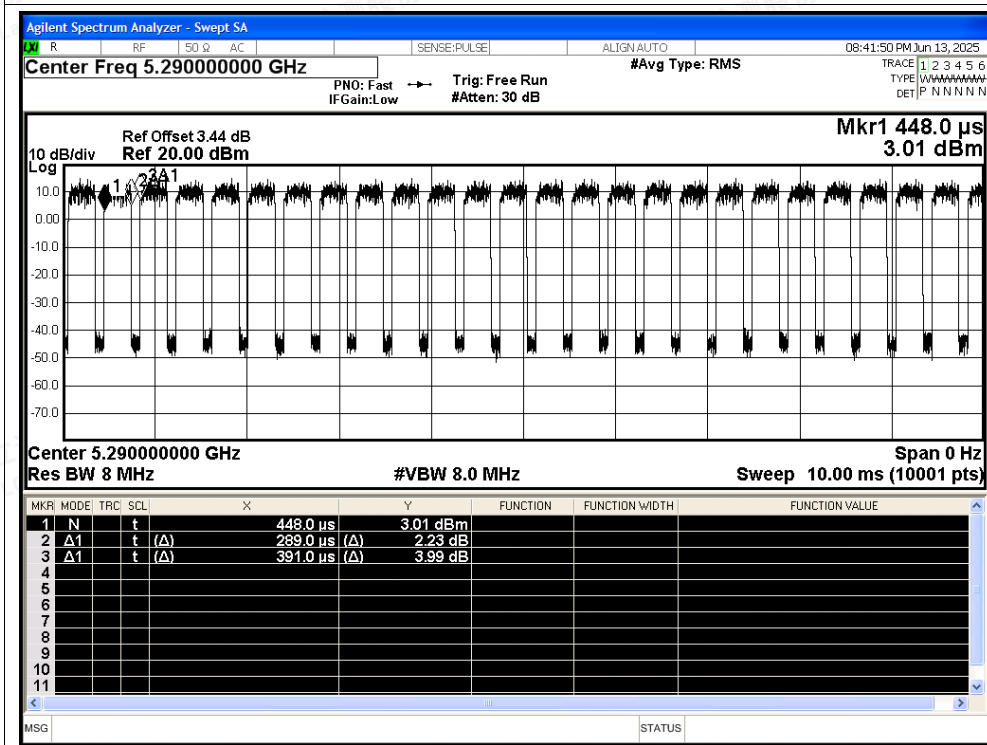

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5260MHz Ant1

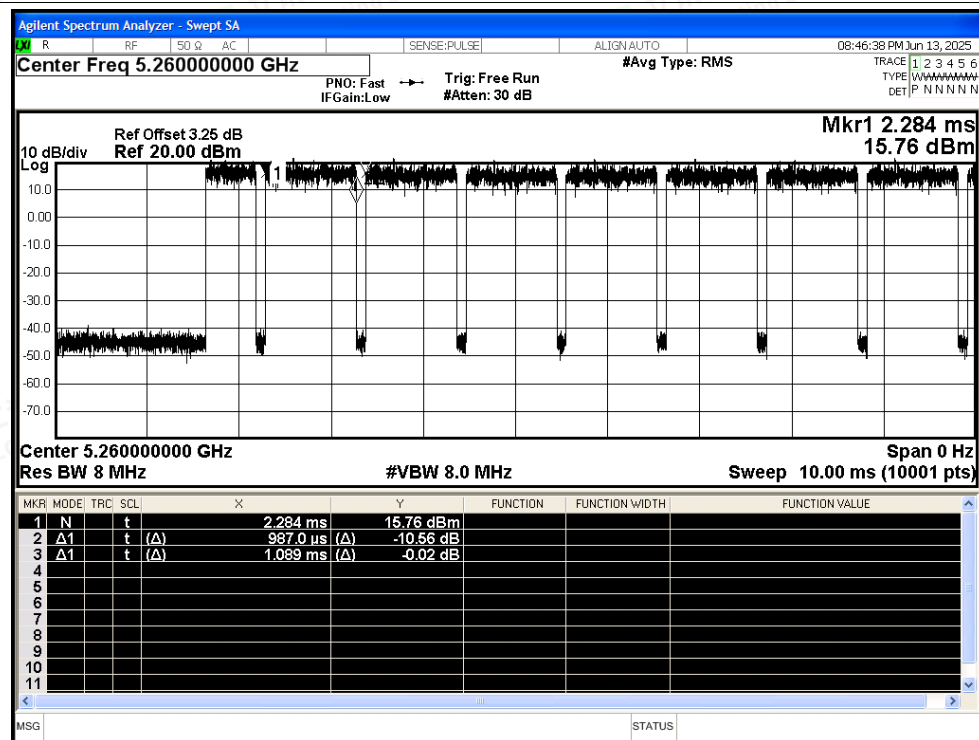

Duty Cycle NVNT ax20 5300MHz Ant1

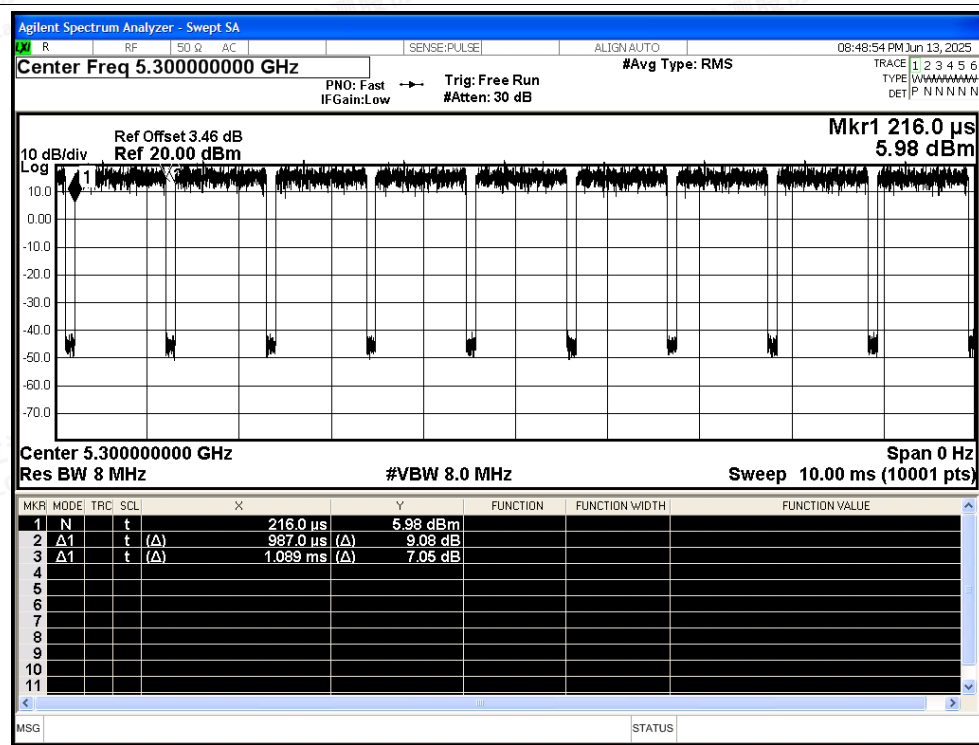

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity