



| Condition | Mode | Frequency (MHz) | Antenna | Spur Freq (MHz) | Power (dBm) | Gain (dBi) | Duty Factor (dB) | EIRP Power (dBm) | Detector | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|-----------------|-------------|------------|------------------|------------------|----------|-------------|---------|
| NVNT      | a    | 5745            | Ant2    | 5650            | -49.55      | 2.00       | -                | -47.55           | Peak     | -27         | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5650            | -56.97      | 2.00       | 0.31             | -54.66           | Average  | -27         | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5700            | -48.57      | 2.00       | -                | -46.57           | Peak     | 10          | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5700            | -56.96      | 2.00       | 0.31             | -54.65           | Average  | 10          | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5720            | -46.14      | 2.00       | -                | -44.14           | Peak     | 15.6        | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5720            | -54.92      | 2.00       | 0.31             | -52.61           | Average  | 15.6        | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5725            | -45.01      | 2.00       | -                | -43.01           | Peak     | 27          | Pass    |
| NVNT      | a    | 5745            | Ant2    | 5725            | -52.73      | 2.00       | 0.31             | -50.42           | Average  | 27          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5850            | -45.22      | 2.00       | -                | -43.22           | Peak     | 27          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5850            | -54.41      | 2.00       | 0.31             | -52.10           | Average  | 27          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5855            | -48.04      | 2.00       | -                | -46.04           | Peak     | 15.6        | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5855            | -55.33      | 2.00       | 0.31             | -53.02           | Average  | 15.6        | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5875            | -48.64      | 2.00       | -                | -46.64           | Peak     | 10          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5875            | -56.39      | 2.00       | 0.31             | -54.08           | Average  | 10          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5925            | -49.09      | 2.00       | -                | -47.09           | Peak     | -27         | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5925            | -56.46      | 2.00       | 0.31             | -54.15           | Average  | -27         | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5650            | -48.19      | 2.00       | -                | -46.19           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5650            | -57.62      | 2.00       | 0.37             | -55.25           | Average  | -27         | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5700            | -49.52      | 2.00       | -                | -47.52           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5700            | -56.85      | 2.00       | 0.37             | -54.48           | Average  | 10          | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5720            | -45.1       | 2.00       | -                | -43.10           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5720            | -54.69      | 2.00       | 0.37             | -52.32           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5725            | -39.15      | 2.00       | -                | -37.15           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5725            | -52.03      | 2.00       | 0.37             | -49.66           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5850            | -44.32      | 2.00       | -                | -42.32           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5850            | -54.15      | 2.00       | 0.37             | -51.78           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5855            | -47.29      | 2.00       | -                | -45.29           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5855            | -55.29      | 2.00       | 0.37             | -52.92           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5875            | -48.53      | 2.00       | -                | -46.53           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5875            | -56.14      | 2.00       | 0.37             | -53.77           | Average  | 10          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5925            | -47.8       | 2.00       | -                | -45.80           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5925            | -56.65      | 2.00       | 0.37             | -54.28           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5650            | -48.63      | 2.00       | -                | -46.63           | Peak     | -27         | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5650            | -56.65      | 2.00       | 0.71             | -53.94           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5700            | -47.91      | 2.00       | -                | -45.91           | Peak     | 10          | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5700            | -55.58      | 2.00       | 0.71             | -52.87           | Average  | 10          | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5720            | -45.1       | 2.00       | -                | -43.10           | Peak     | 15.6        | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5720            | -54.27      | 2.00       | 0.71             | -51.56           | Average  | 15.6        | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | n40  | 5755 | Ant2 | 5725 | -43.78 | 2.00 | -    | -41.78 | Peak    | 27   | Pass |
| NVNT | n40  | 5755 | Ant2 | 5725 | -53.8  | 2.00 | 0.71 | -51.09 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5850 | -47.03 | 2.00 | -    | -45.03 | Peak    | 27   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5850 | -55.85 | 2.00 | 0.71 | -53.14 | Average | 27   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5855 | -48.16 | 2.00 | -    | -46.16 | Peak    | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant2 | 5855 | -54.88 | 2.00 | 0.71 | -52.17 | Average | 15.6 | Pass |
| NVNT | n40  | 5795 | Ant2 | 5875 | -47.28 | 2.00 | -    | -45.28 | Peak    | 10   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5875 | -56.64 | 2.00 | 0.71 | -53.93 | Average | 10   | Pass |
| NVNT | n40  | 5795 | Ant2 | 5925 | -49.43 | 2.00 | -    | -47.43 | Peak    | -27  | Pass |
| NVNT | n40  | 5795 | Ant2 | 5925 | -56.14 | 2.00 | 0.71 | -53.43 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5650 | -49.34 | 2.00 | -    | -47.34 | Peak    | -27  | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5650 | -57.23 | 2.00 | 0.37 | -54.86 | Average | -27  | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5700 | -49.42 | 2.00 | -    | -47.42 | Peak    | 10   | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5700 | -56.58 | 2.00 | 0.37 | -54.21 | Average | 10   | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5720 | -45.63 | 2.00 | -    | -43.63 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5720 | -54.87 | 2.00 | 0.37 | -52.50 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5725 | -43.13 | 2.00 | -    | -41.13 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | Ant2 | 5725 | -51.86 | 2.00 | 0.37 | -49.49 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5850 | -47.02 | 2.00 | -    | -45.02 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5850 | -54.31 | 2.00 | 0.37 | -51.94 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5855 | -44.11 | 2.00 | -    | -42.11 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5855 | -56.04 | 2.00 | 0.37 | -53.67 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5875 | -49    | 2.00 | -    | -47.00 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5875 | -56.78 | 2.00 | 0.37 | -54.41 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5925 | -49.61 | 2.00 | -    | -47.61 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | Ant2 | 5925 | -56.29 | 2.00 | 0.37 | -53.92 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5650 | -48.8  | 2.00 | -    | -46.80 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5650 | -57.05 | 2.00 | 0.7  | -54.35 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5700 | -47.63 | 2.00 | -    | -45.63 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5700 | -55.96 | 2.00 | 0.7  | -53.26 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5720 | -45.09 | 2.00 | -    | -43.09 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5720 | -54.58 | 2.00 | 0.7  | -51.88 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5725 | -45.36 | 2.00 | -    | -43.36 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | Ant2 | 5725 | -53.78 | 2.00 | 0.7  | -51.08 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5850 | -47.37 | 2.00 | -    | -45.37 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5850 | -54.86 | 2.00 | 0.71 | -52.15 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5855 | -47.64 | 2.00 | -    | -45.64 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5855 | -55.7  | 2.00 | 0.71 | -52.99 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5875 | -48.31 | 2.00 | -    | -46.31 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5875 | -56.64 | 2.00 | 0.71 | -53.93 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | Ant2 | 5925 | -47.94 | 2.00 | -    | -45.94 | Peak    | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | ac40 | 5795 | Ant2 | 5925 | -56.62 | 2.00 | 0.71 | -53.91 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5850 | -39    | 2.00 | -    | -37.00 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5850 | -49.93 | 2.00 | 1.3  | -46.63 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5855 | -37.92 | 2.00 | -    | -35.92 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5855 | -49.31 | 2.00 | 1.3  | -46.01 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5875 | -42.16 | 2.00 | -    | -40.16 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5875 | -53.12 | 2.00 | 1.3  | -49.82 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5925 | -48.54 | 2.00 | -    | -46.54 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5925 | -56.68 | 2.00 | 1.3  | -53.38 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5650 | -47.06 | 2.00 | -    | -45.06 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5650 | -56.67 | 2.00 | 1.3  | -53.37 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5700 | -41.95 | 2.00 | -    | -39.95 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5700 | -52.83 | 2.00 | 1.3  | -49.53 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5720 | -43.41 | 2.00 | -    | -41.41 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5720 | -51.54 | 2.00 | 1.3  | -48.24 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5725 | -39.29 | 2.00 | -    | -37.29 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | Ant2 | 5725 | -51.12 | 2.00 | 1.3  | -47.82 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5650 | -49.18 | 2.00 | -    | -47.18 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5650 | -57.61 | 2.00 | 0.42 | -55.19 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5700 | -48.1  | 2.00 | -    | -46.10 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5700 | -56.85 | 2.00 | 0.42 | -54.43 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5720 | -47.36 | 2.00 | -    | -45.36 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5720 | -54.54 | 2.00 | 0.42 | -52.12 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5725 | -43.26 | 2.00 | -    | -41.26 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | Ant2 | 5725 | -51.32 | 2.00 | 0.42 | -48.90 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5850 | -43.7  | 2.00 | -    | -41.70 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5850 | -54.64 | 2.00 | 0.37 | -52.27 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5855 | -43.73 | 2.00 | -    | -41.73 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5855 | -55.78 | 2.00 | 0.37 | -53.41 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5875 | -46.66 | 2.00 | -    | -44.66 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5875 | -56.95 | 2.00 | 0.37 | -54.58 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5925 | -48.45 | 2.00 | -    | -46.45 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | Ant2 | 5925 | -56.13 | 2.00 | 0.37 | -53.76 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5650 | -47.08 | 2.00 | -    | -45.08 | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5650 | -57    | 2.00 | 0.71 | -54.29 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5700 | -47.2  | 2.00 | -    | -45.20 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5700 | -55.33 | 2.00 | 0.71 | -52.62 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5720 | -46.86 | 2.00 | -    | -44.86 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5720 | -54.32 | 2.00 | 0.71 | -51.61 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5725 | -45.06 | 2.00 | -    | -43.06 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | Ant2 | 5725 | -53.74 | 2.00 | 0.71 | -51.03 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |      |      |        |      |      |        |         |      |      |
|------|------|------|------|------|--------|------|------|--------|---------|------|------|
| NVNT | ax40 | 5795 | Ant2 | 5850 | -47.14 | 2.00 | -    | -45.14 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5850 | -55.1  | 2.00 | 0.7  | -52.40 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5855 | -48.52 | 2.00 | -    | -46.52 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5855 | -55.74 | 2.00 | 0.7  | -53.04 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5875 | -48.26 | 2.00 | -    | -46.26 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5875 | -56.32 | 2.00 | 0.7  | -53.62 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5925 | -47.18 | 2.00 | -    | -45.18 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | Ant2 | 5925 | -56.8  | 2.00 | 0.7  | -54.10 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5850 | -38.42 | 2.00 | -    | -36.42 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5850 | -49.91 | 2.00 | 1.31 | -46.60 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5855 | -38.98 | 2.00 | -    | -36.98 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5855 | -50    | 2.00 | 1.31 | -46.69 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5875 | -42.68 | 2.00 | -    | -40.68 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5875 | -52.75 | 2.00 | 1.31 | -49.44 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5925 | -48.57 | 2.00 | -    | -46.57 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5925 | -57.43 | 2.00 | 1.31 | -54.12 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5650 | -48.59 | 2.00 | -    | -46.59 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5650 | -55.88 | 2.00 | 1.31 | -52.57 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5700 | -44.06 | 2.00 | -    | -42.06 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5700 | -53.39 | 2.00 | 1.31 | -50.08 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5720 | -41.49 | 2.00 | -    | -39.49 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5720 | -51.61 | 2.00 | 1.31 | -48.30 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5725 | -40.44 | 2.00 | -    | -38.44 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | Ant2 | 5725 | -50.82 | 2.00 | 1.31 | -47.51 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Restrict Band NVNT a 5745MHz Ant2 Peak

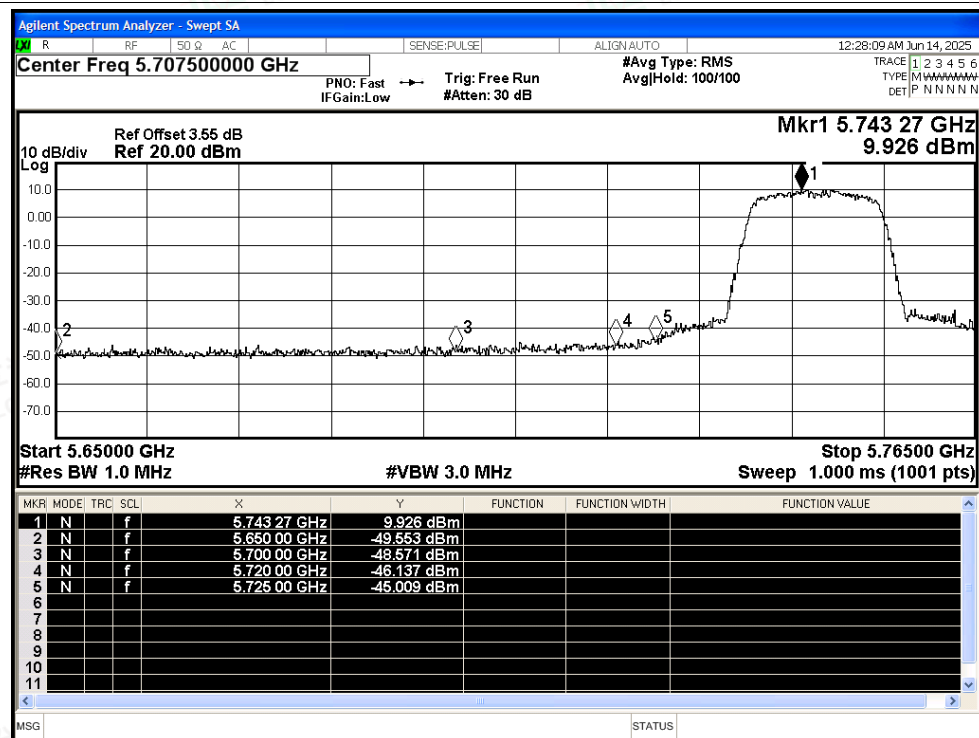

## Restrict Band NVNT a 5745MHz Ant2 Average

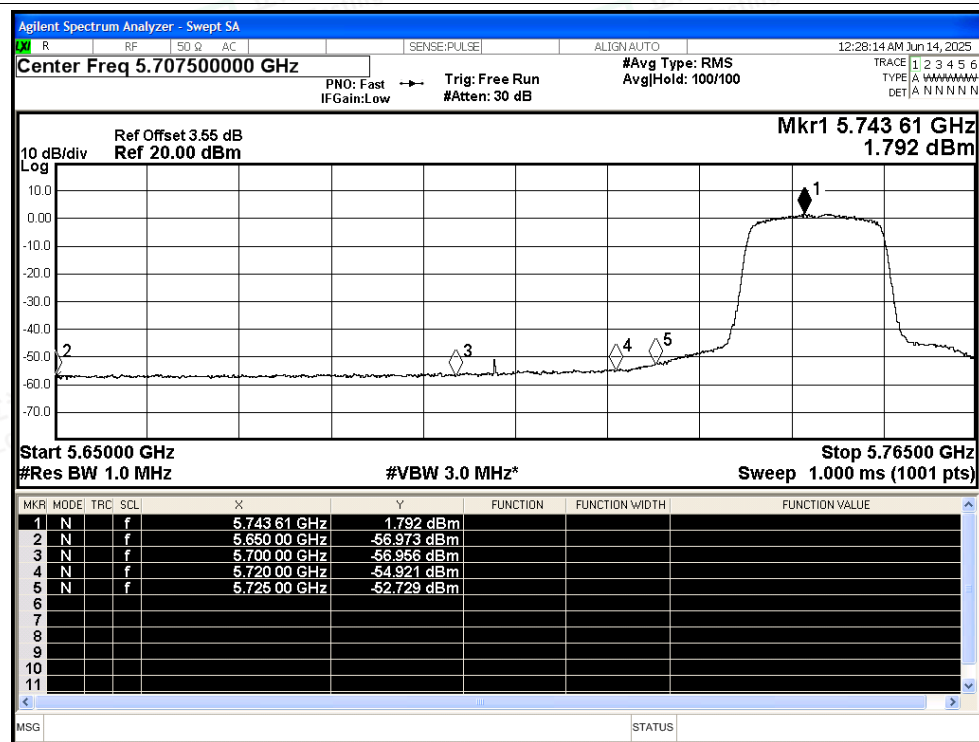

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT a 5825MHz Ant2 Peak

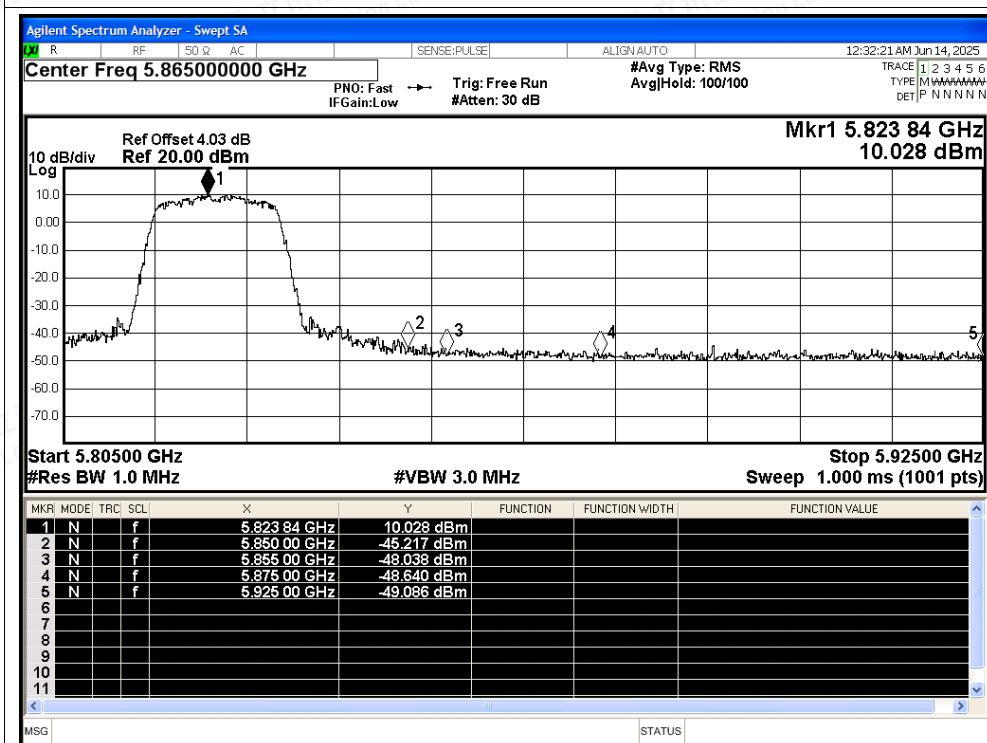

## Restrict Band NVNT a 5825MHz Ant2 Average

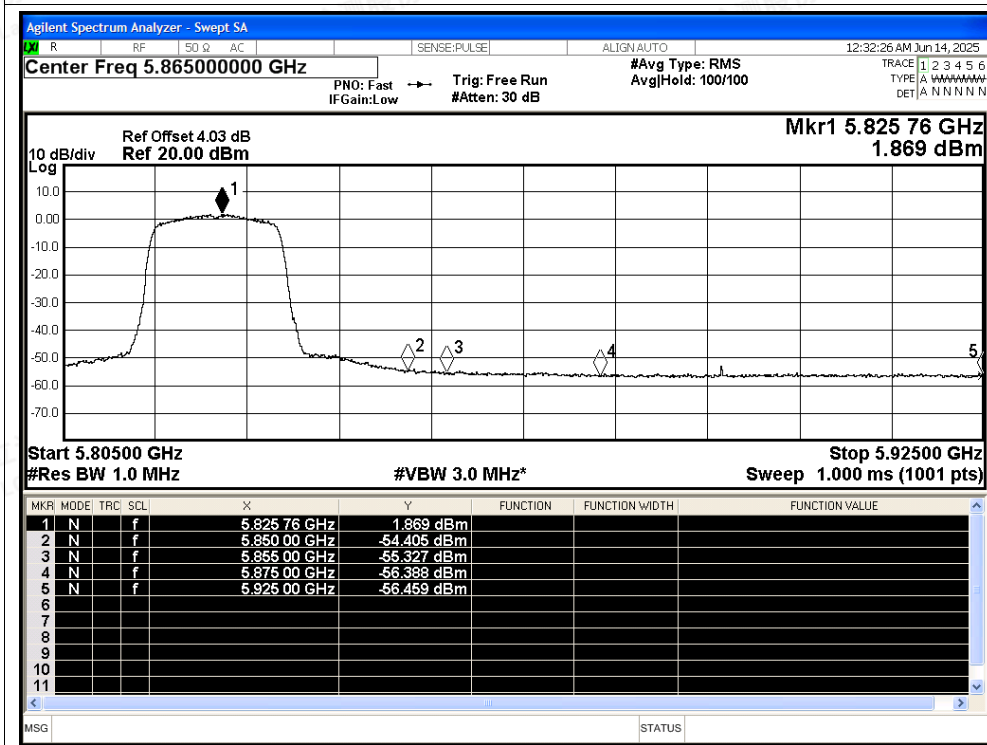

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT n20 5745MHz Ant2 Peak

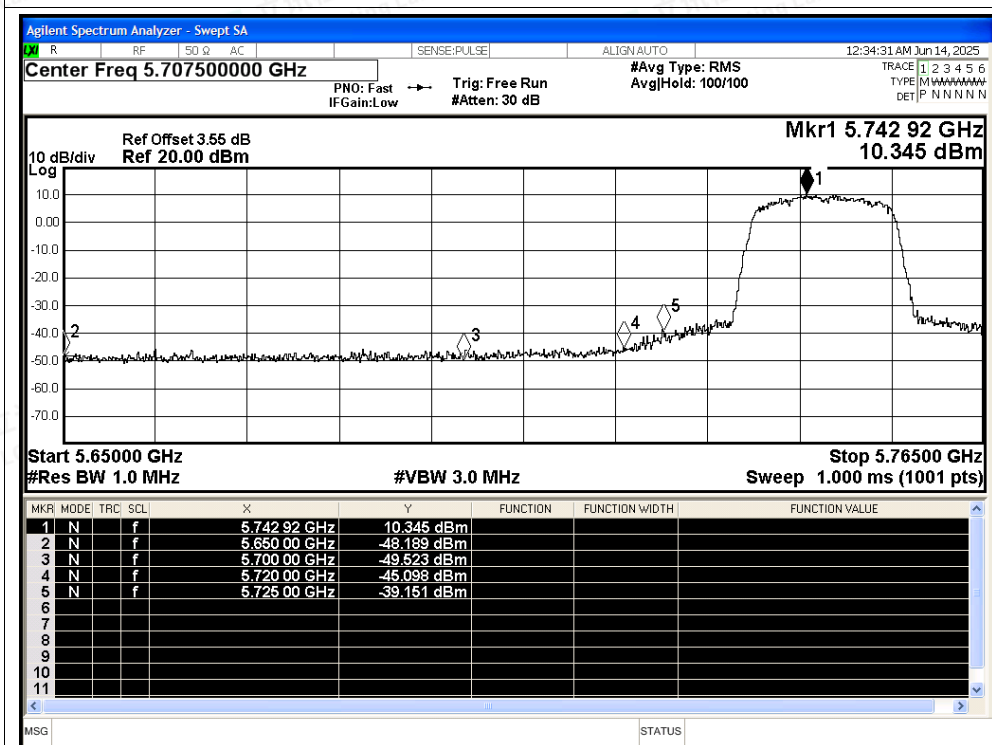

## Restrict Band NVNT n20 5745MHz Ant2 Average

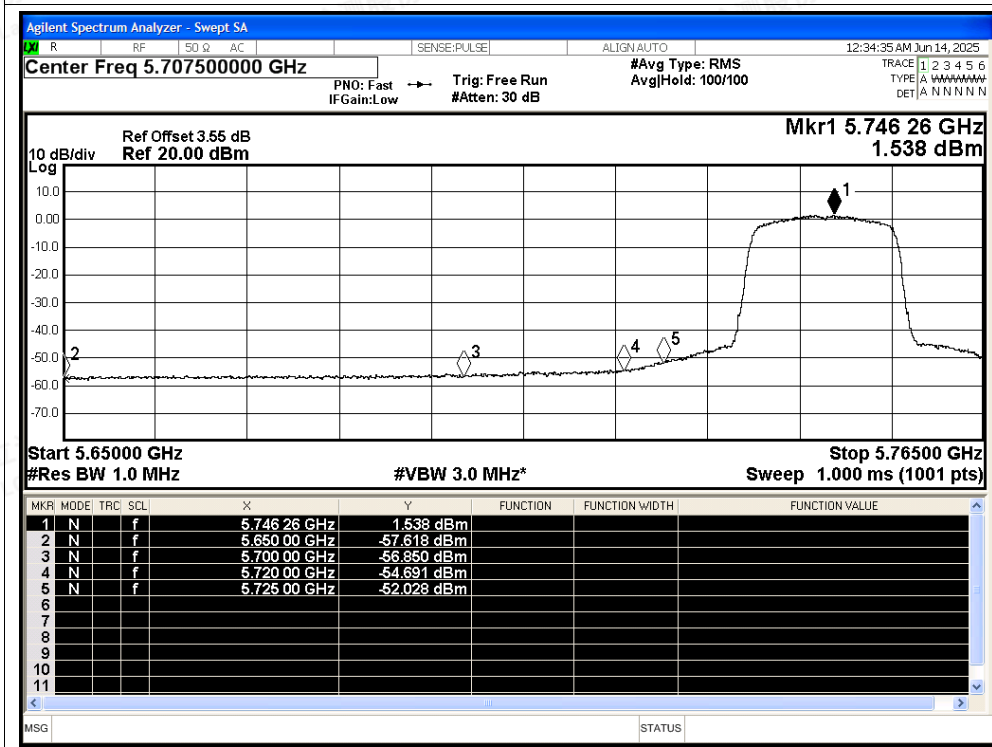

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n20 5825MHz Ant2 Peak

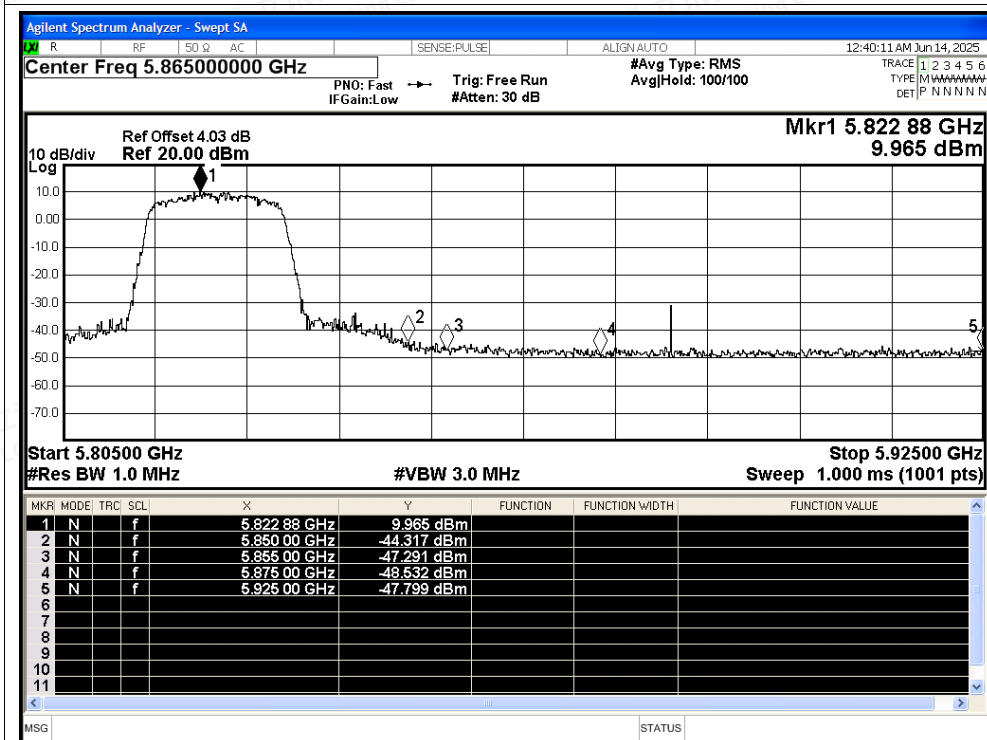

## Restrict Band NVNT n20 5825MHz Ant2 Average

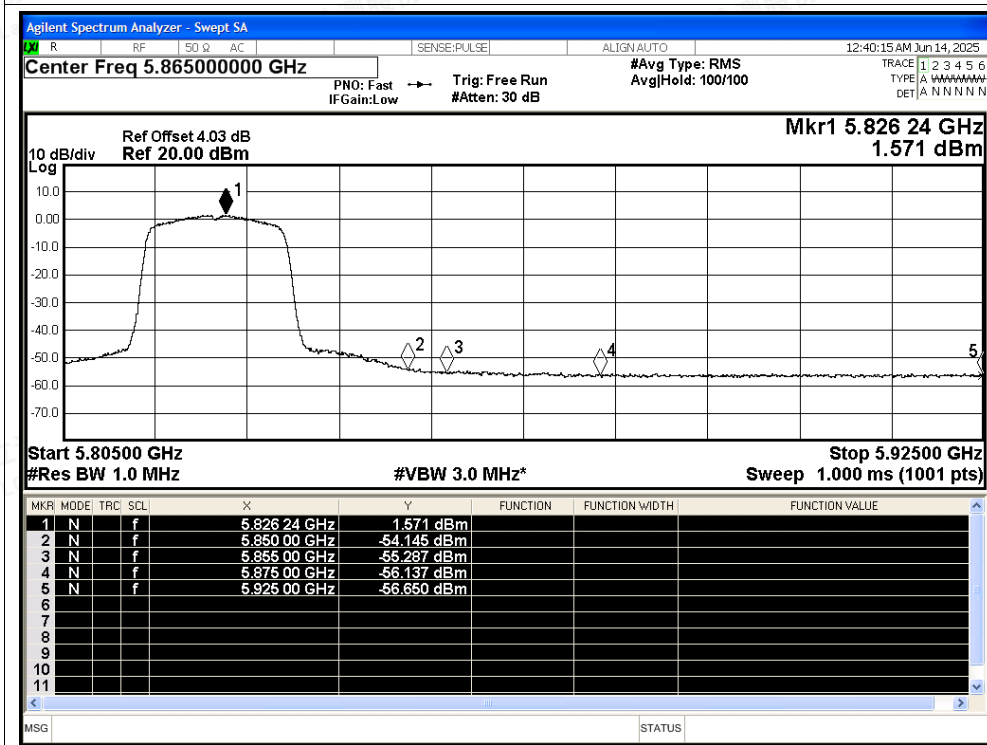

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT n40 5755MHz Ant2 Peak

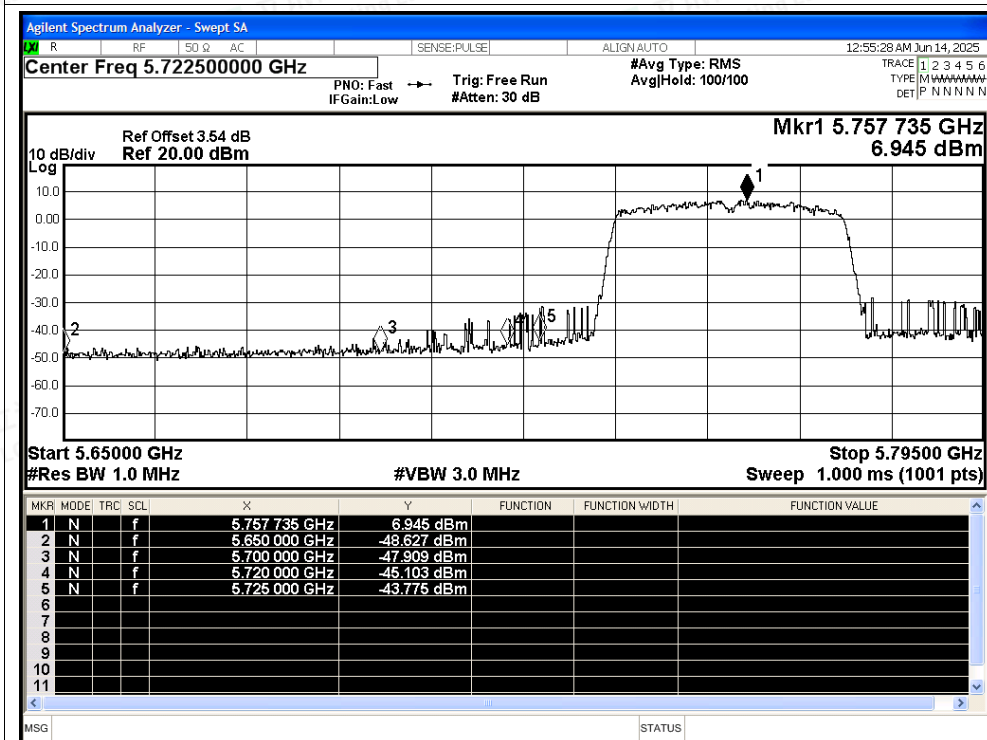

## Restrict Band NVNT n40 5755MHz Ant2 Average

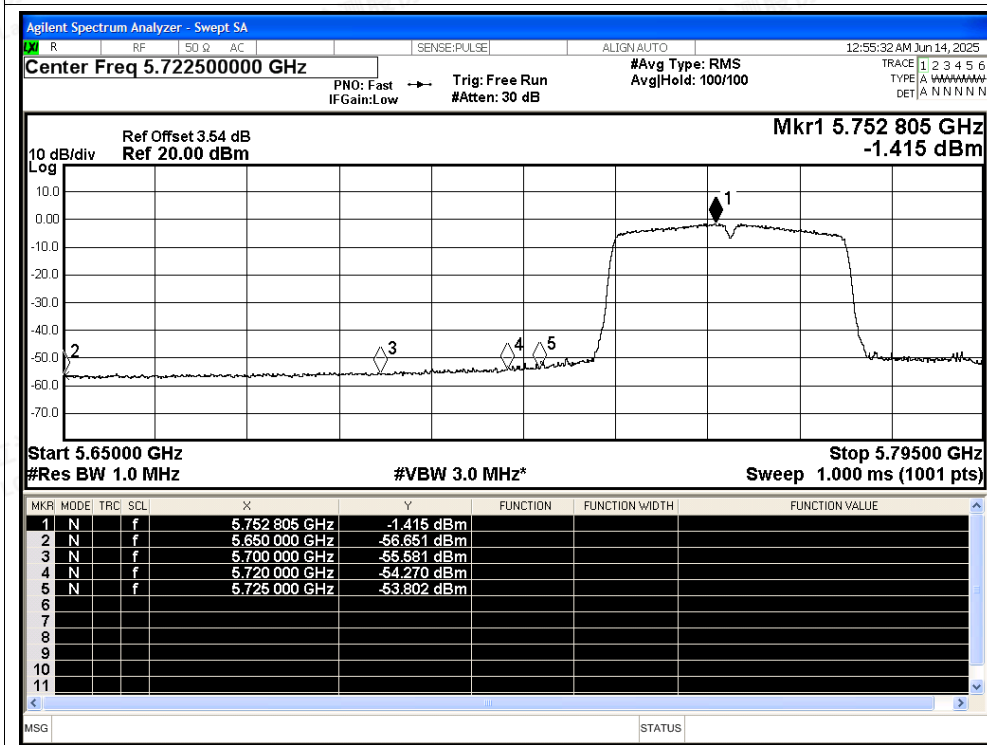

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT n40 5795MHz Ant2 Peak

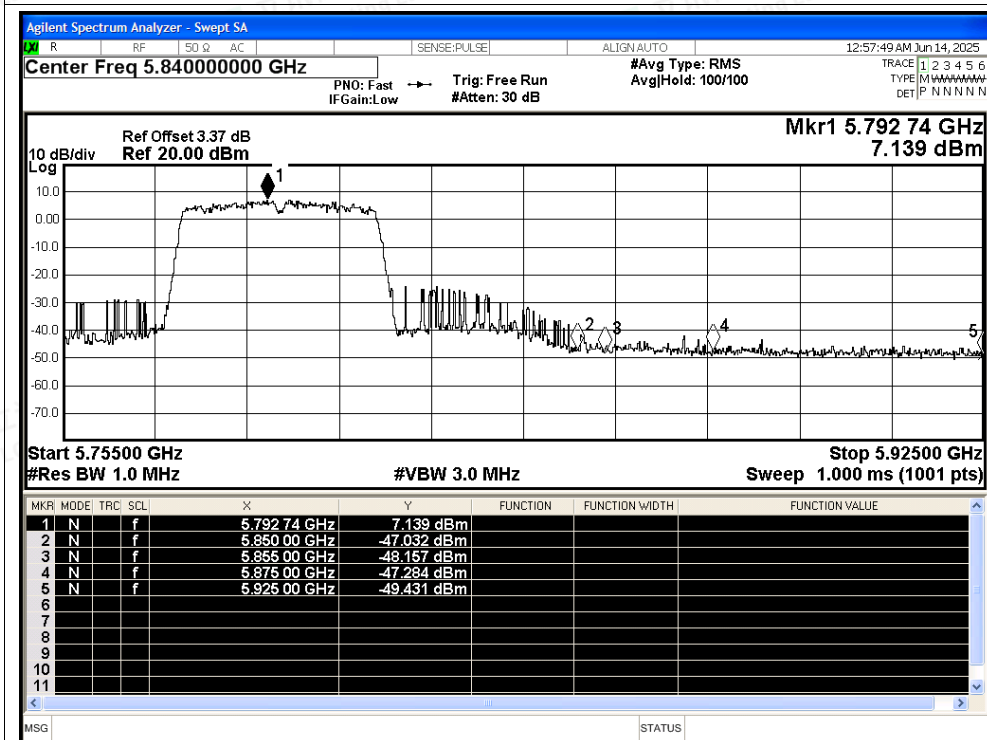

## Restrict Band NVNT n40 5795MHz Ant2 Average

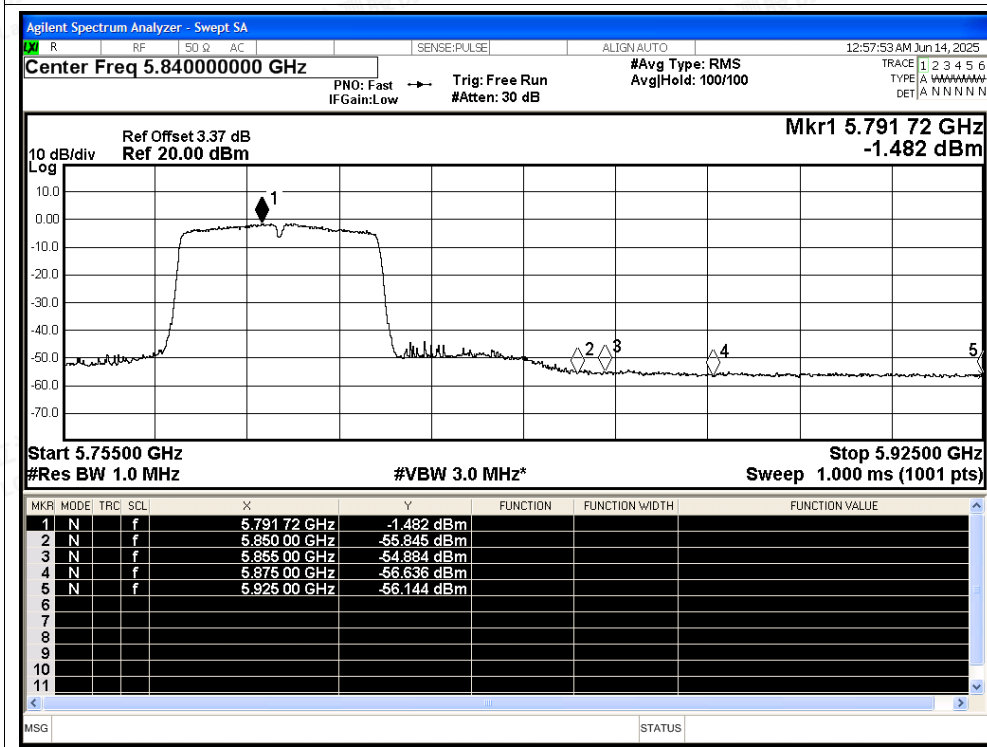

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5745MHz Ant2 Peak

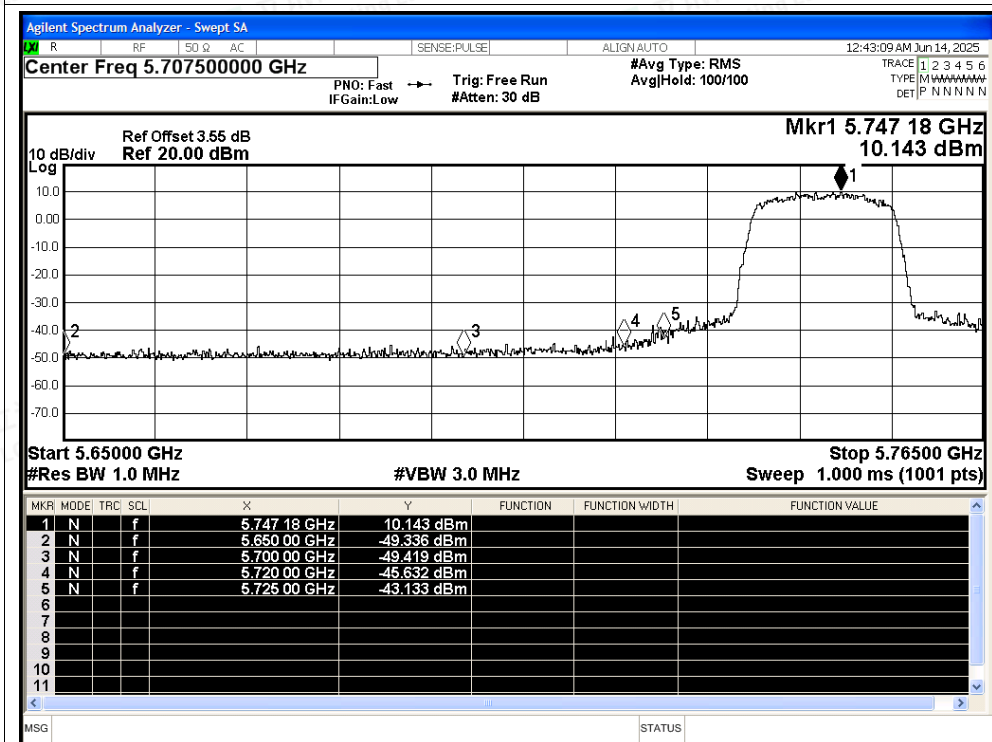

## Restrict Band NVNT ac20 5745MHz Ant2 Average

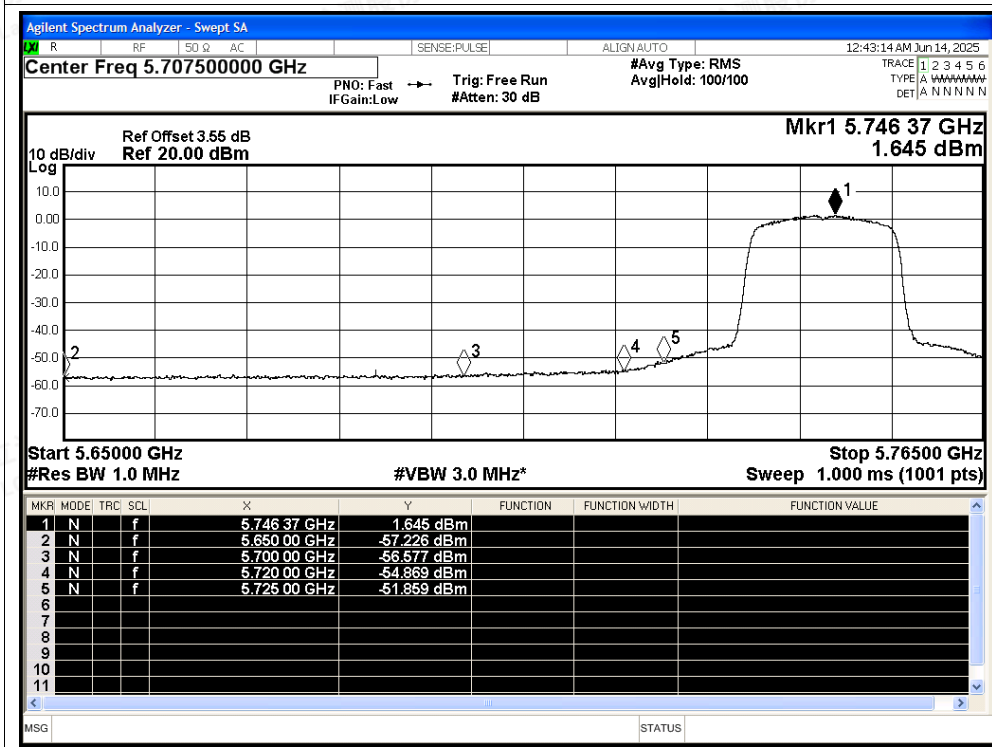

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac20 5825MHz Ant2 Peak

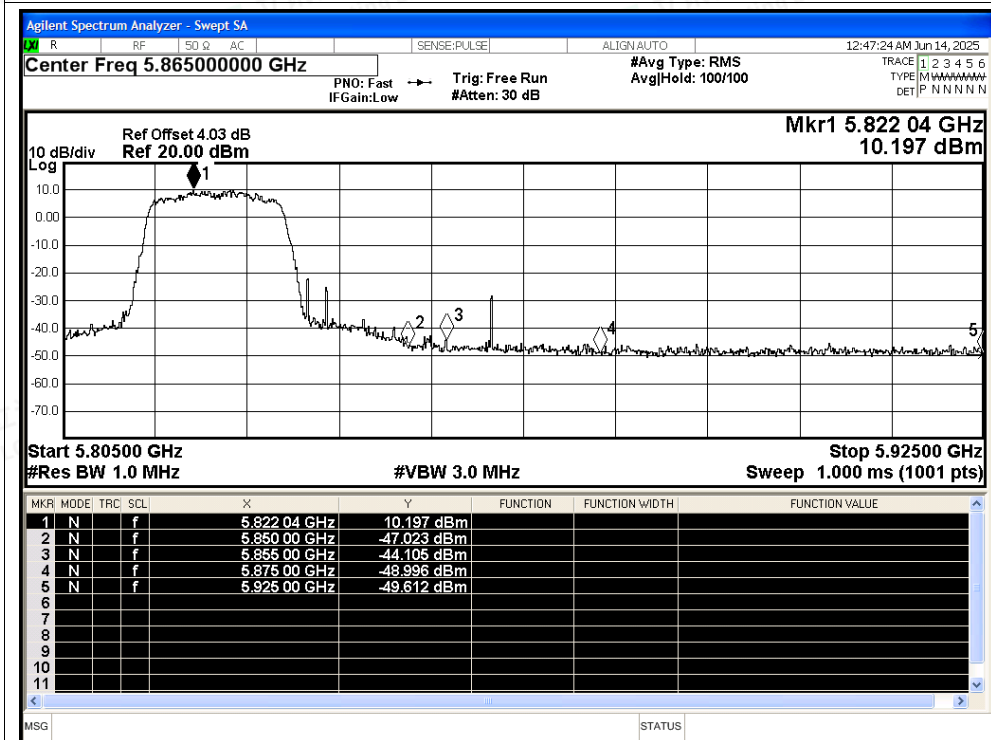

## Restrict Band NVNT ac20 5825MHz Ant2 Average

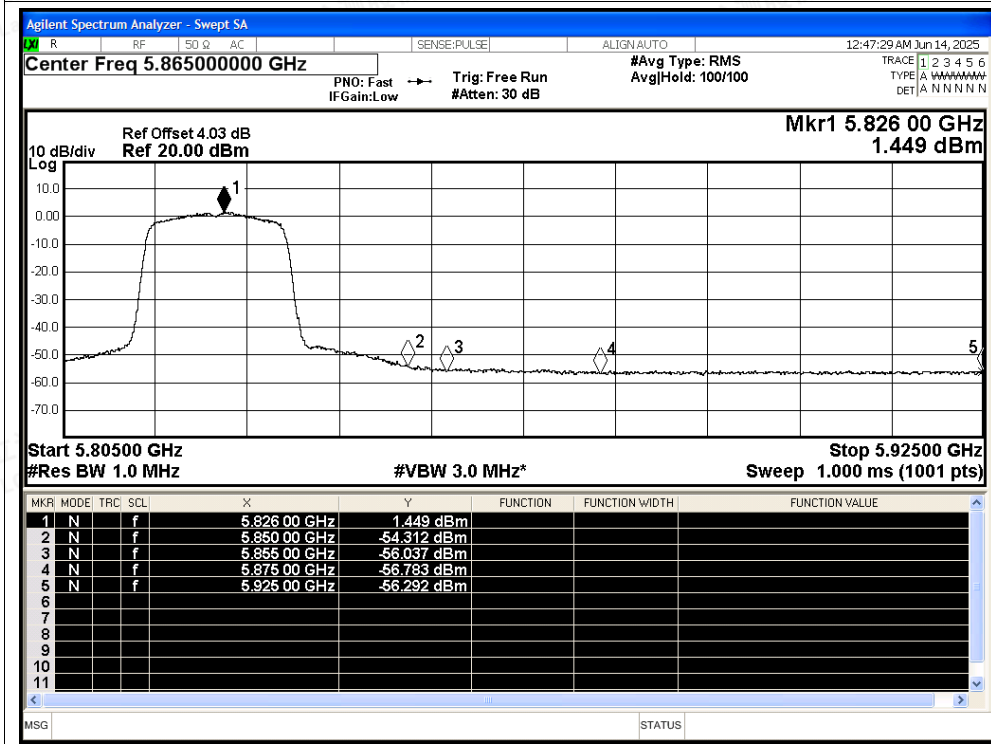

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5755MHz Ant2 Peak

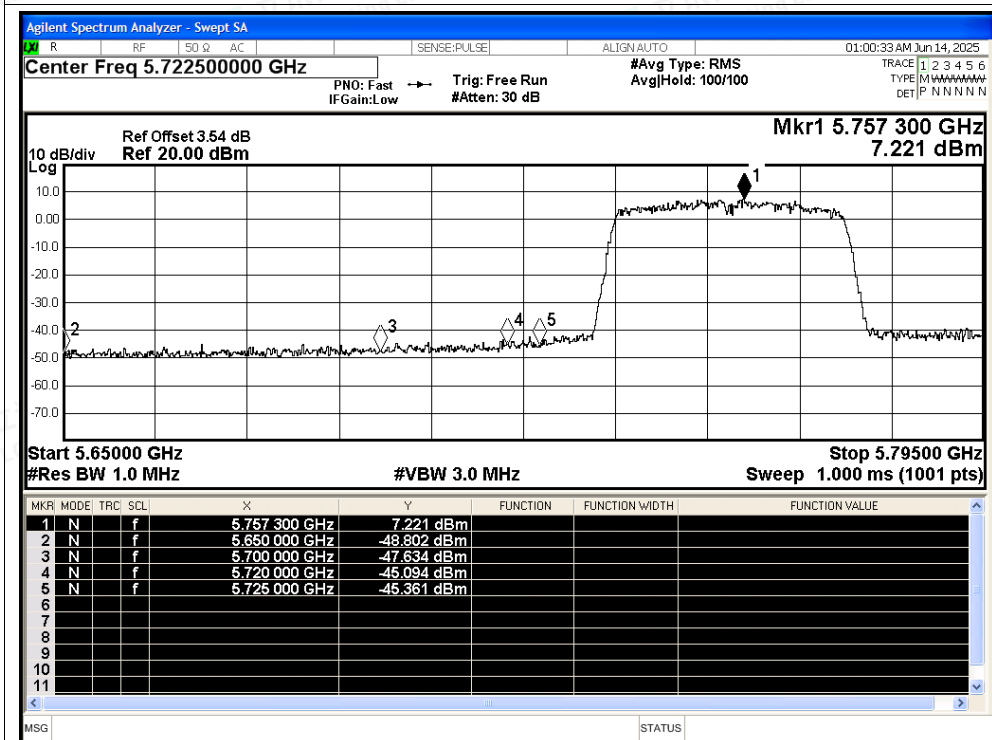

## Restrict Band NVNT ac40 5755MHz Ant2 Average

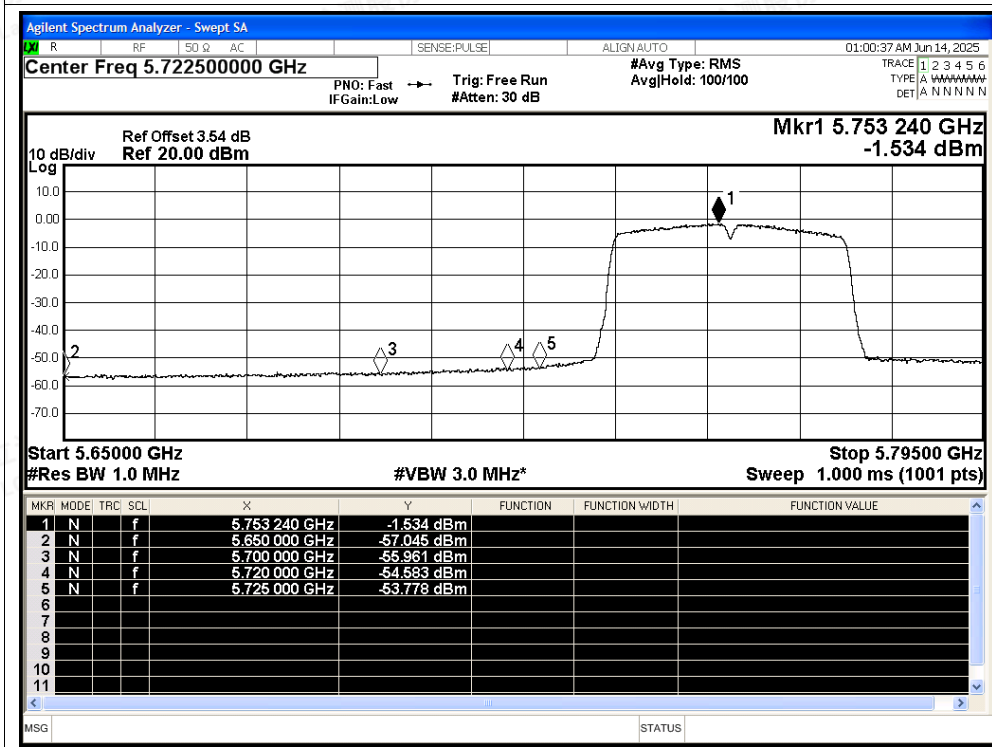

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac40 5795MHz Ant2 Peak

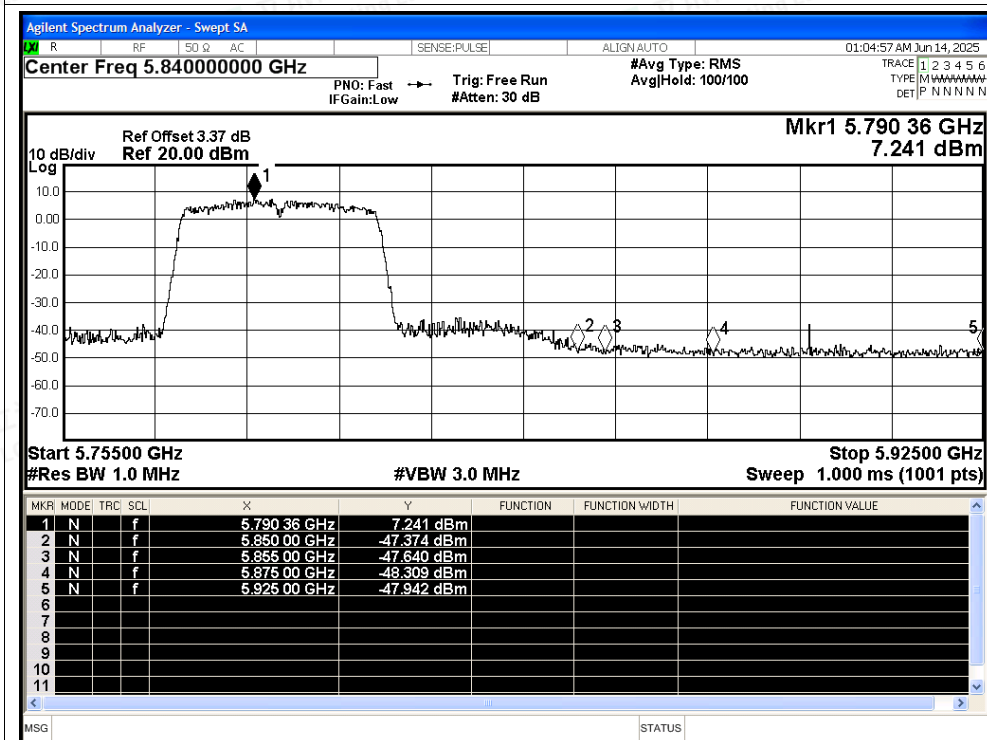

## Restrict Band NVNT ac40 5795MHz Ant2 Average

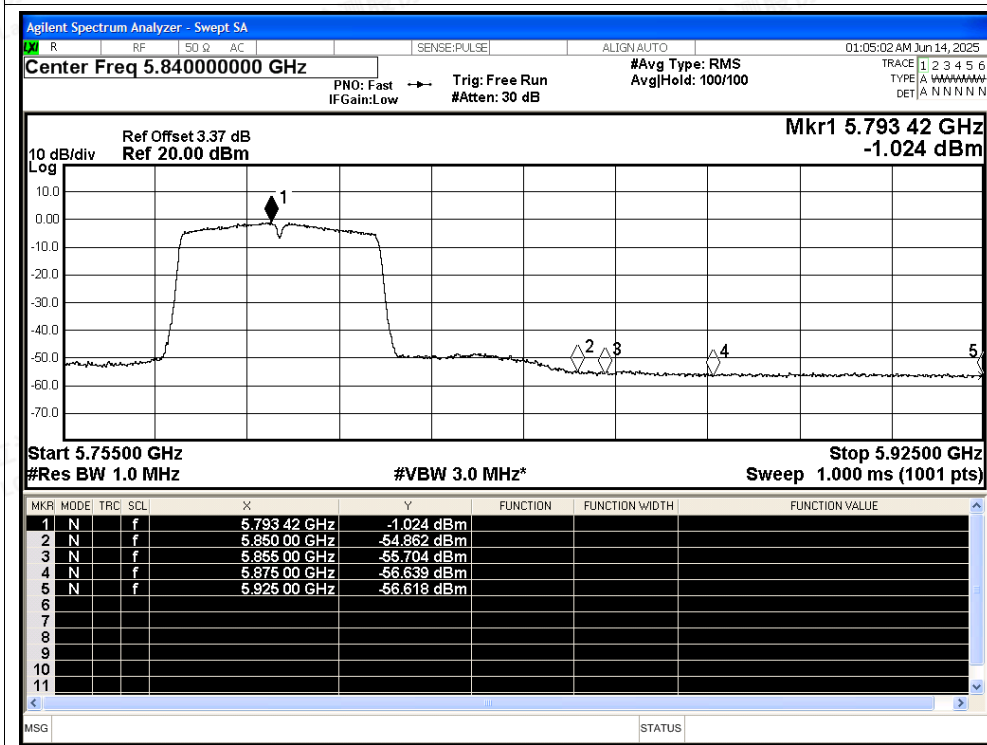

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ac80 5775MHz Ant2 Peak

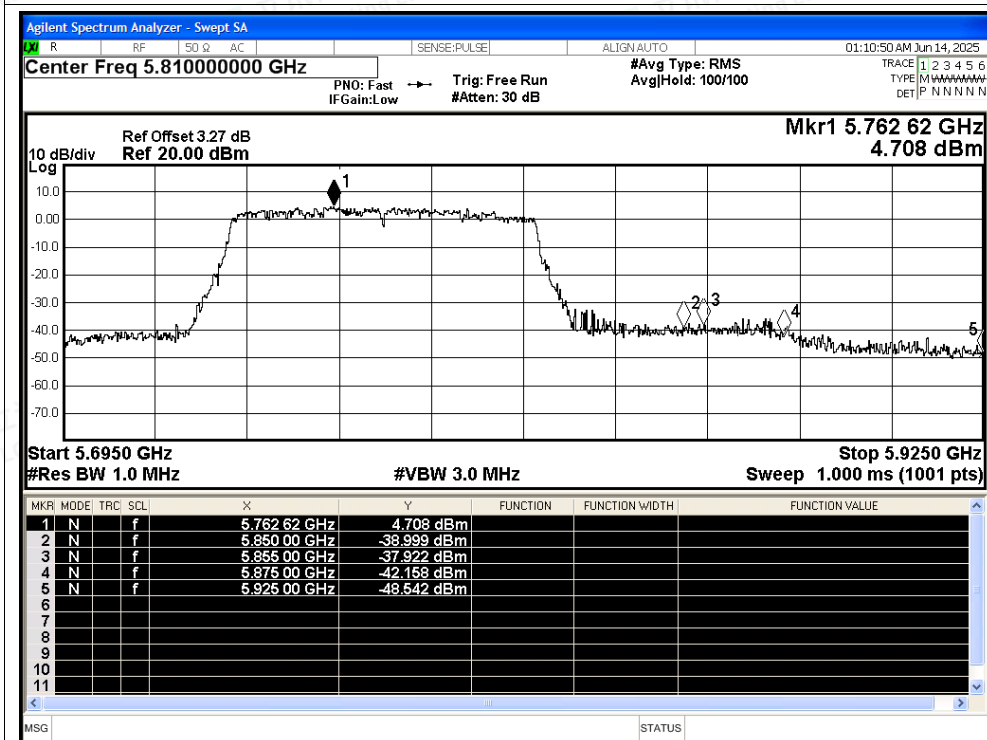

## Restrict Band NVNT ac80 5775MHz Ant2 Average

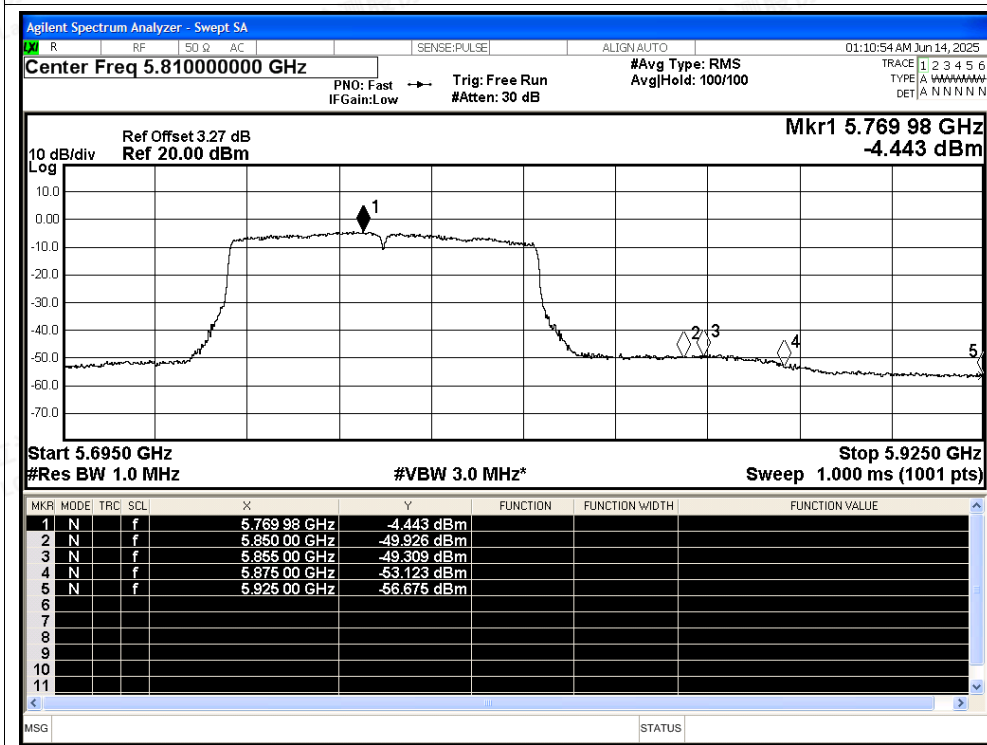

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ac80 5775MHz Ant2 Peak

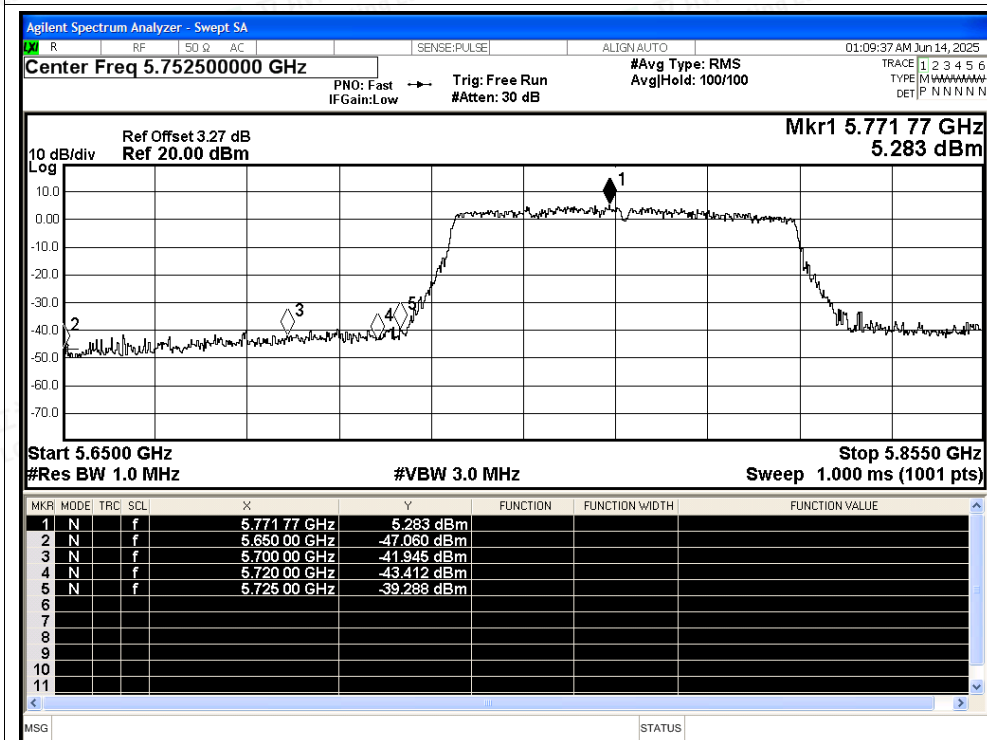

## Restrict Band NVNT ac80 5775MHz Ant2 Average

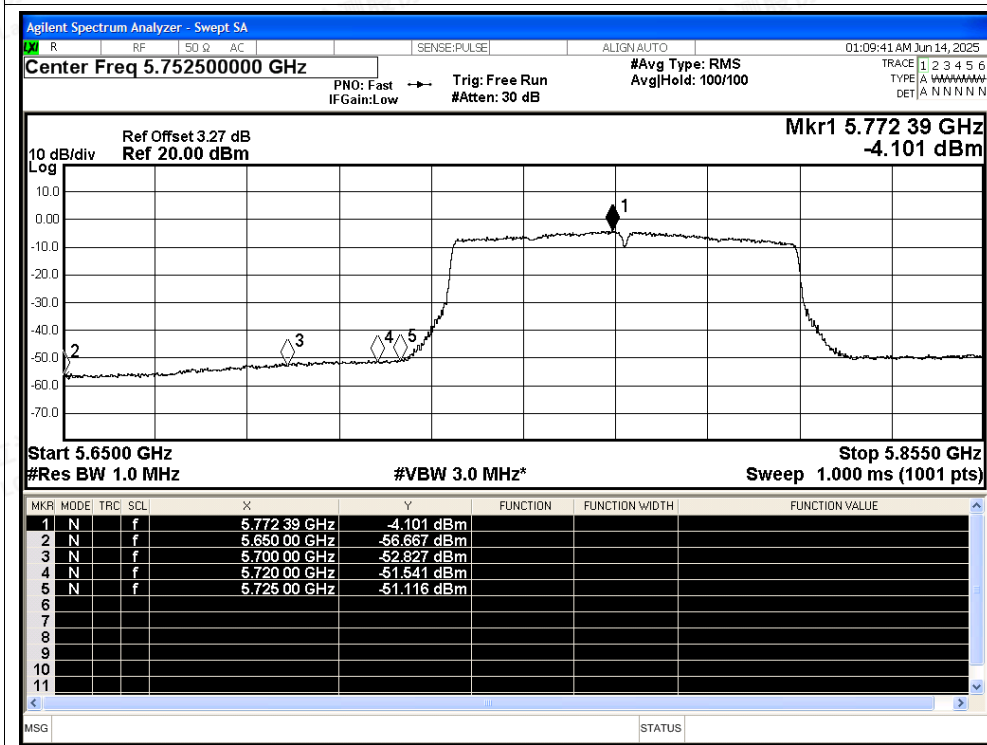

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5745MHz Ant2 Peak

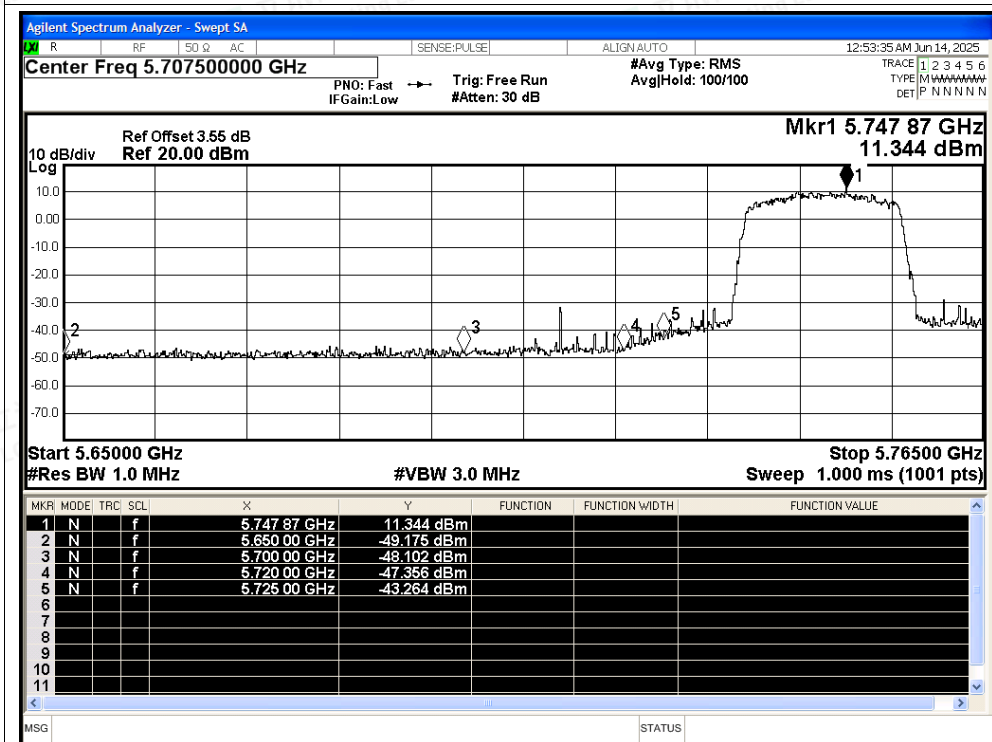

## Restrict Band NVNT ax20 5745MHz Ant2 Average

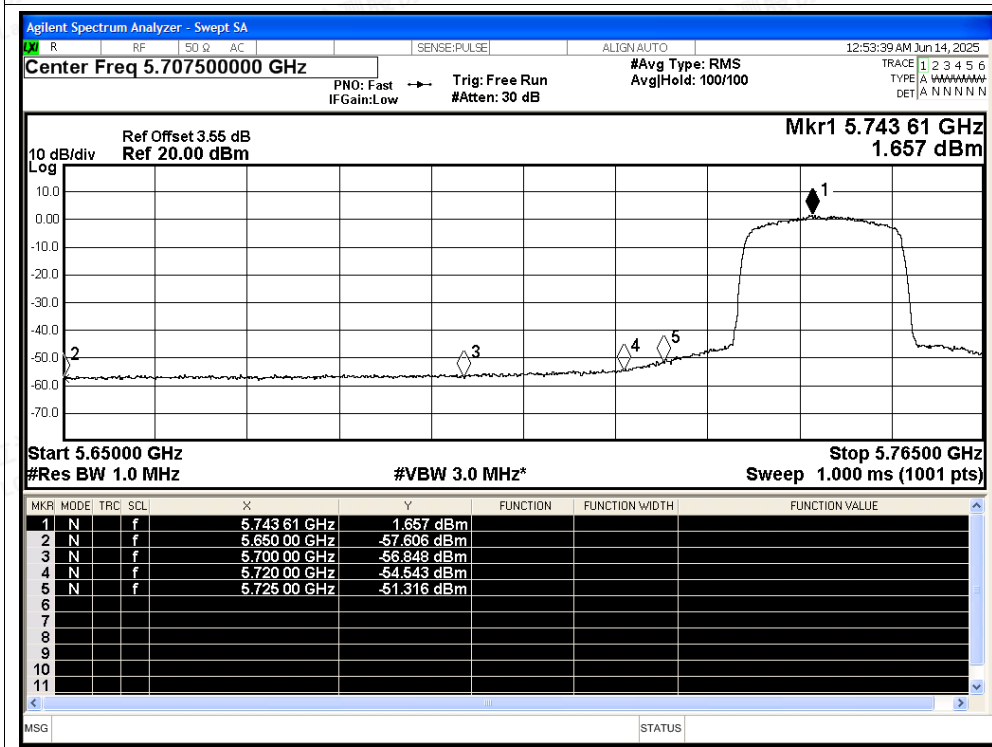

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax20 5825MHz Ant2 Peak

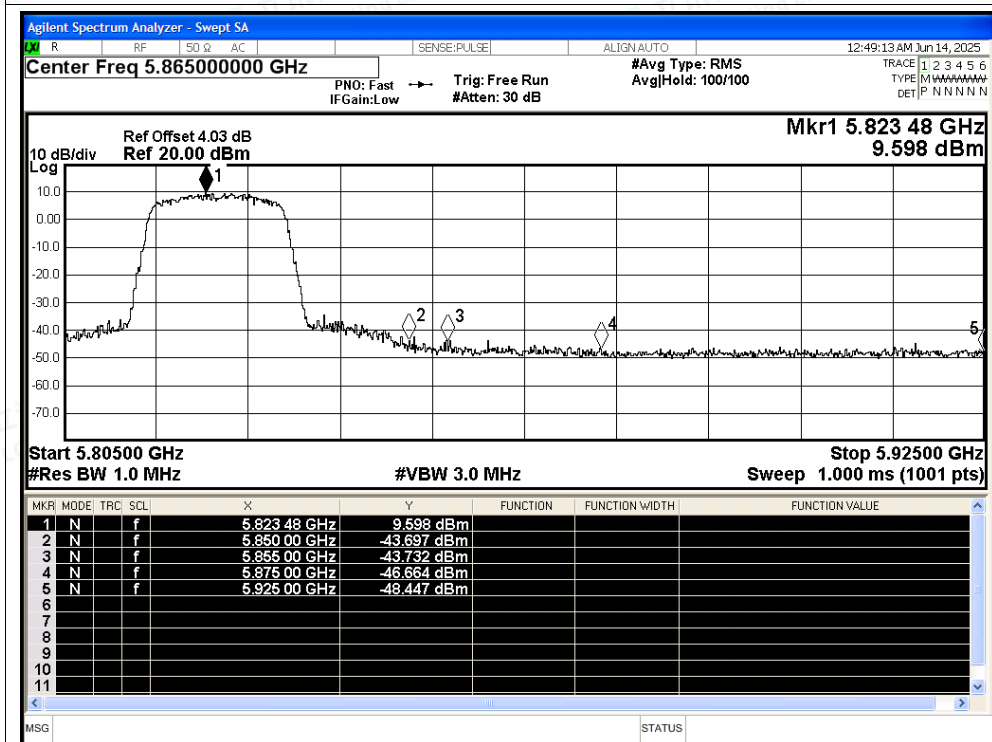

## Restrict Band NVNT ax20 5825MHz Ant2 Average

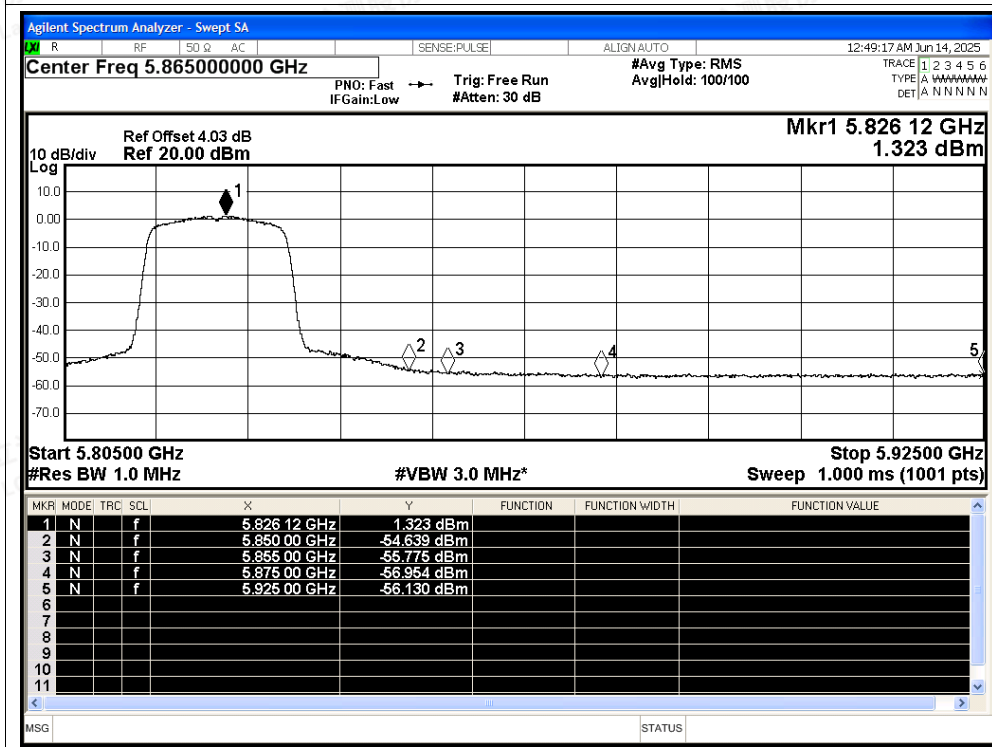

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5755MHz Ant2 Peak

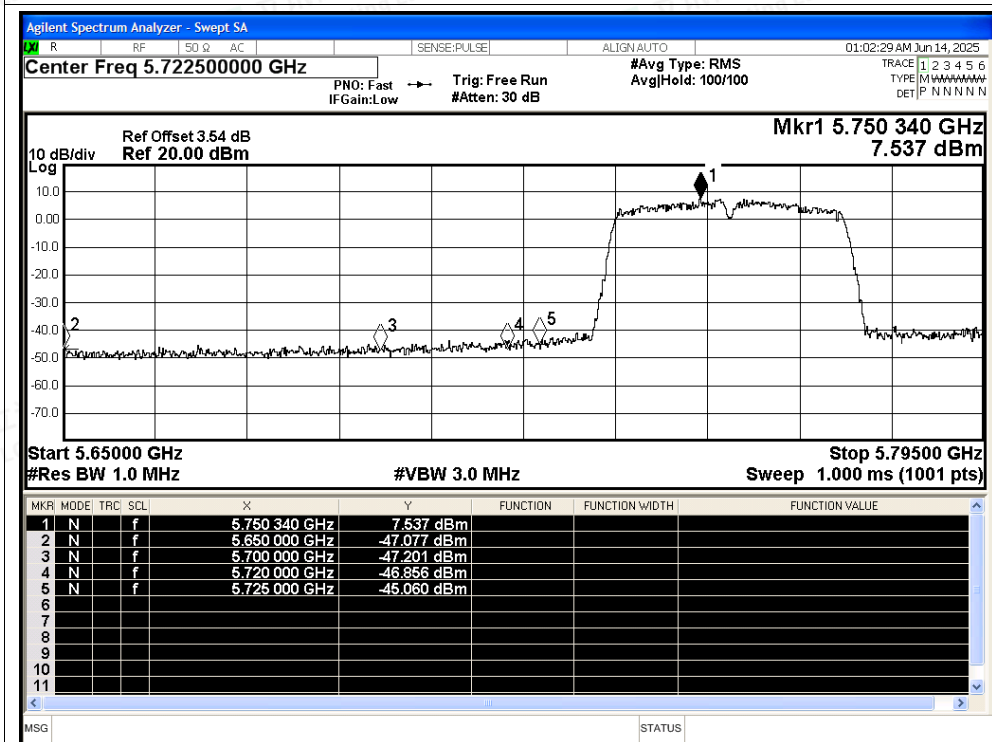

## Restrict Band NVNT ax40 5755MHz Ant2 Average

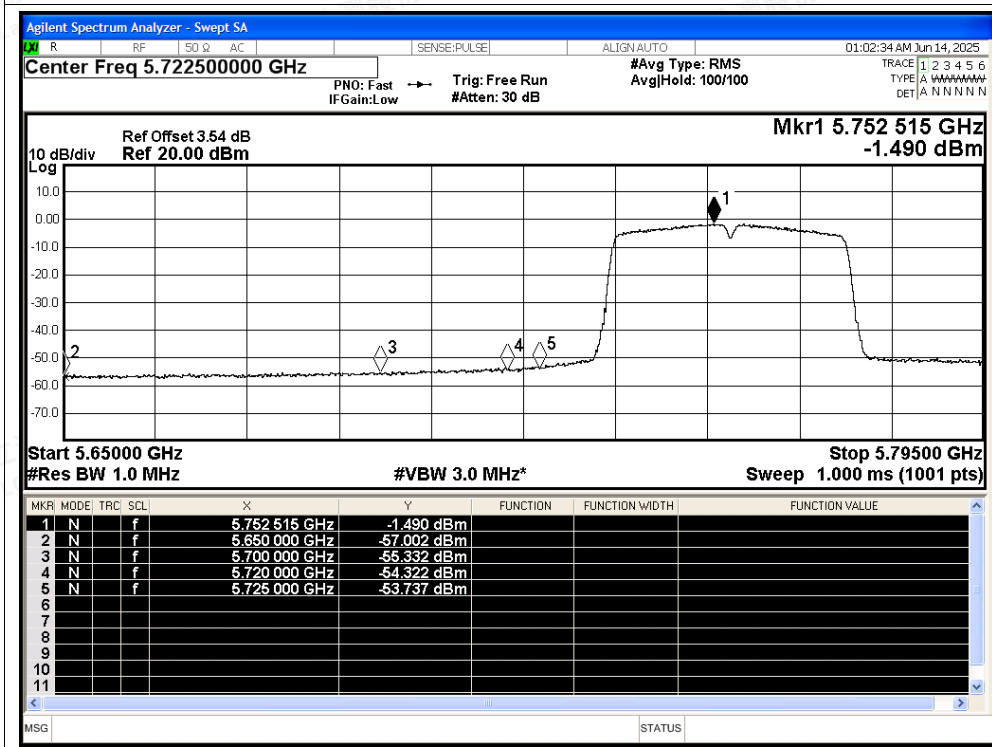

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax40 5795MHz Ant2 Peak

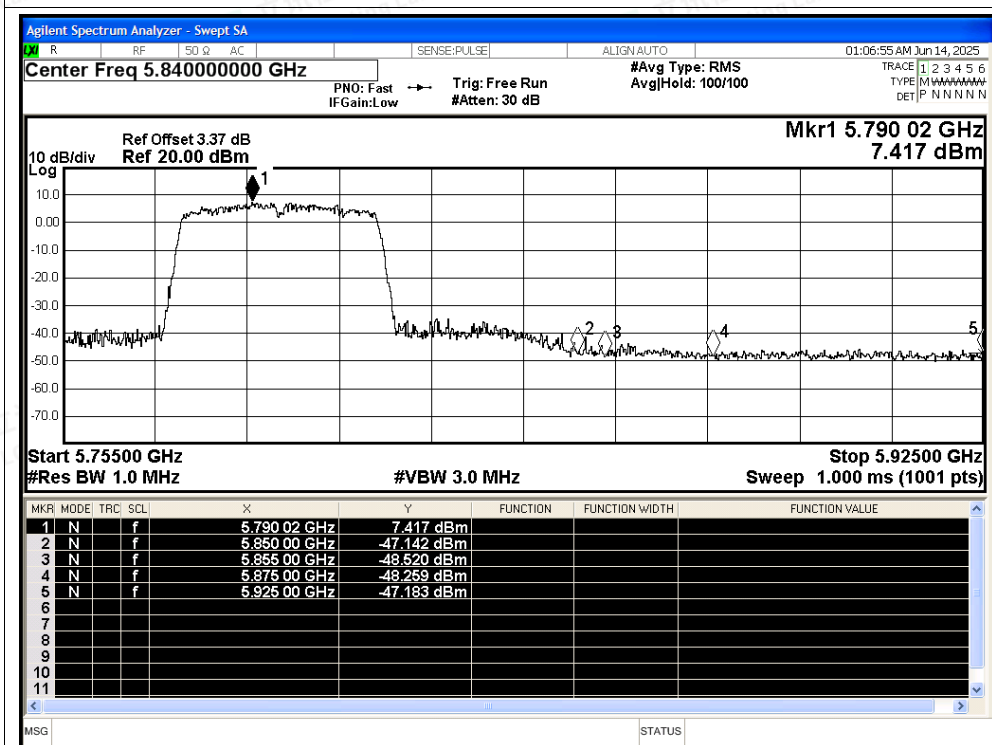

## Restrict Band NVNT ax40 5795MHz Ant2 Average

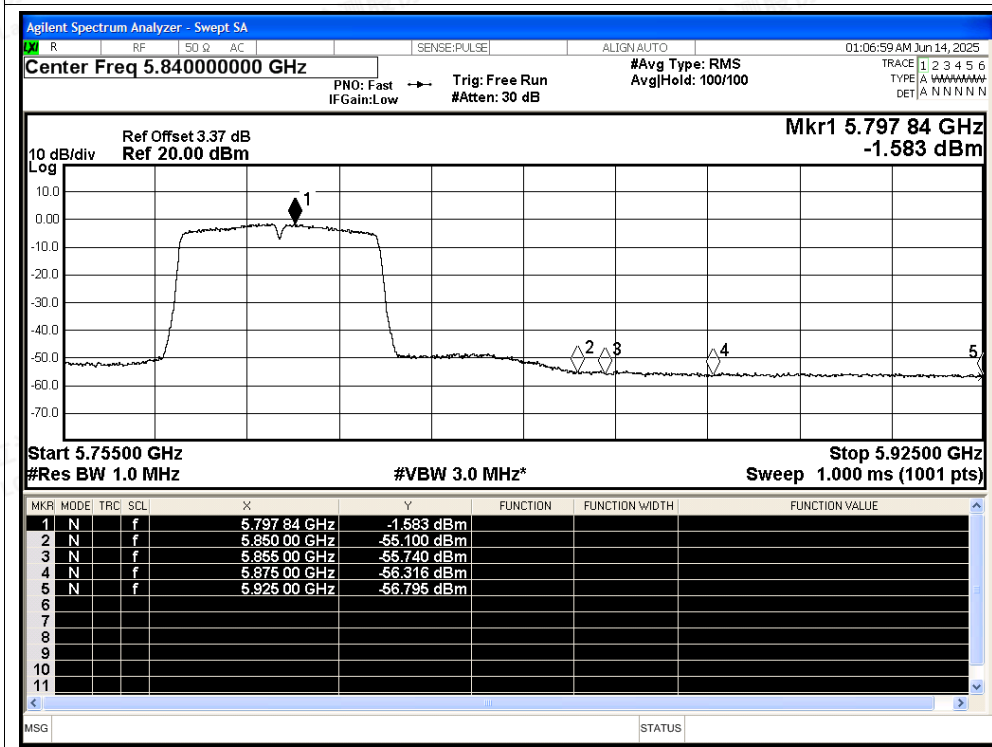

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Restrict Band NVNT ax80 5775MHz Ant2 Peak

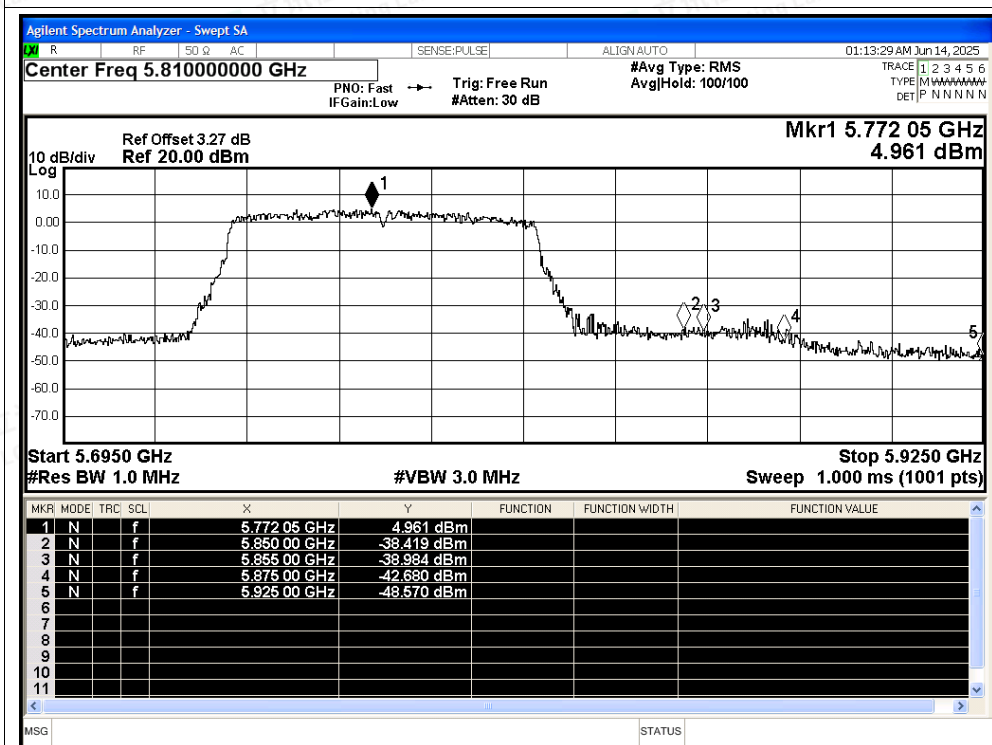

## Restrict Band NVNT ax80 5775MHz Ant2 Average

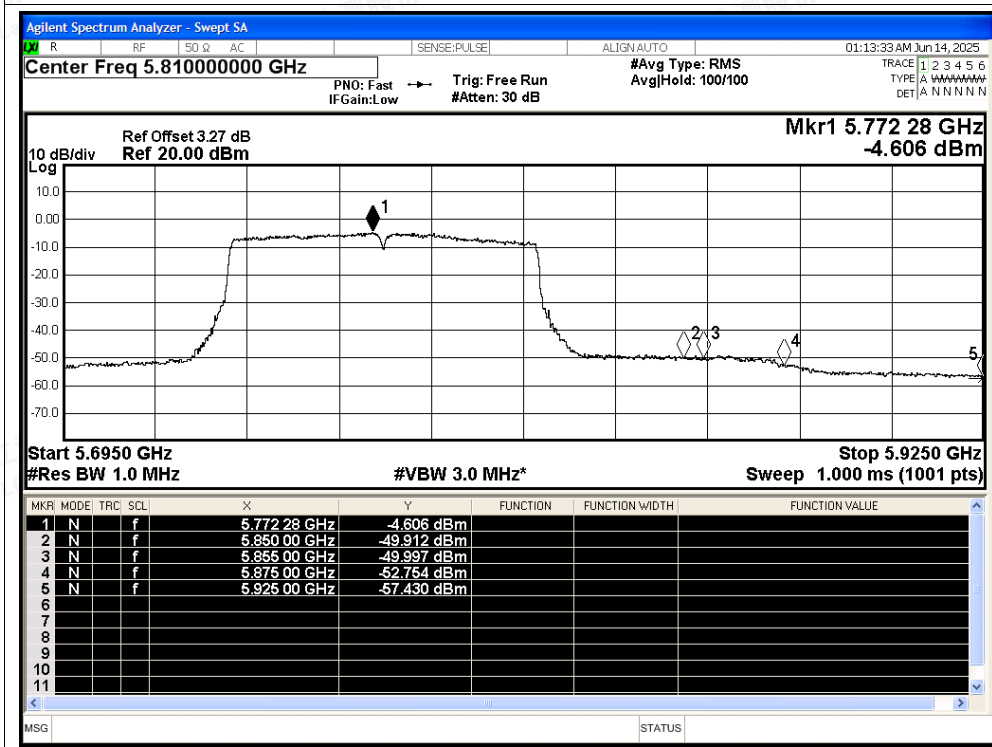

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Restrict Band NVNT ax80 5775MHz Ant2 Peak

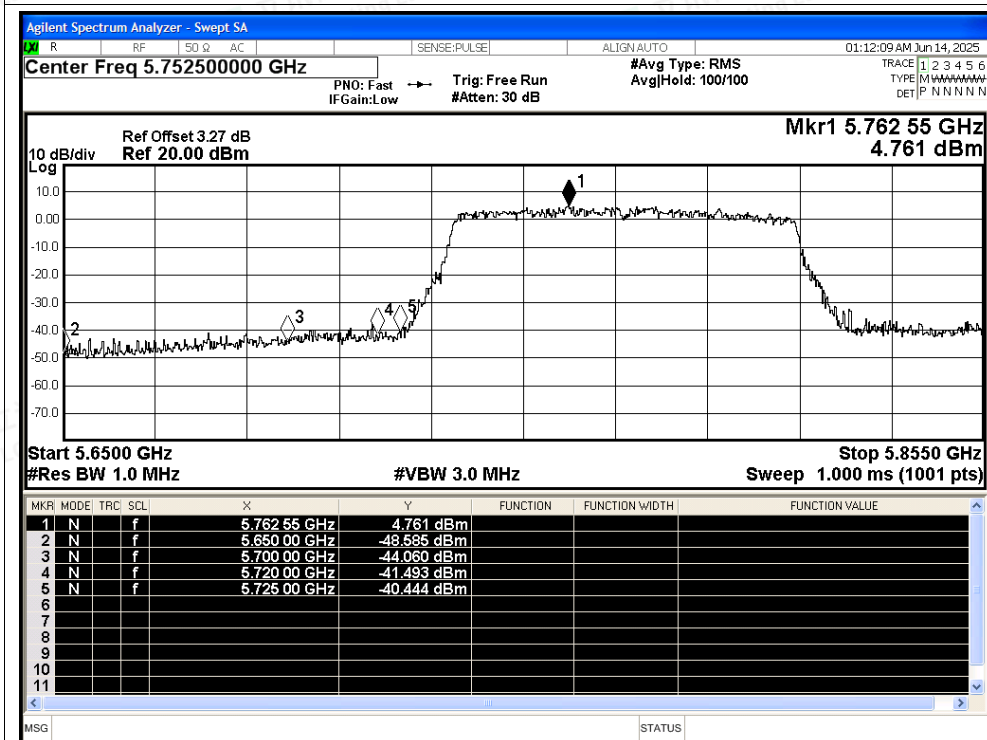

## Restrict Band NVNT ax80 5775MHz Ant2 Average

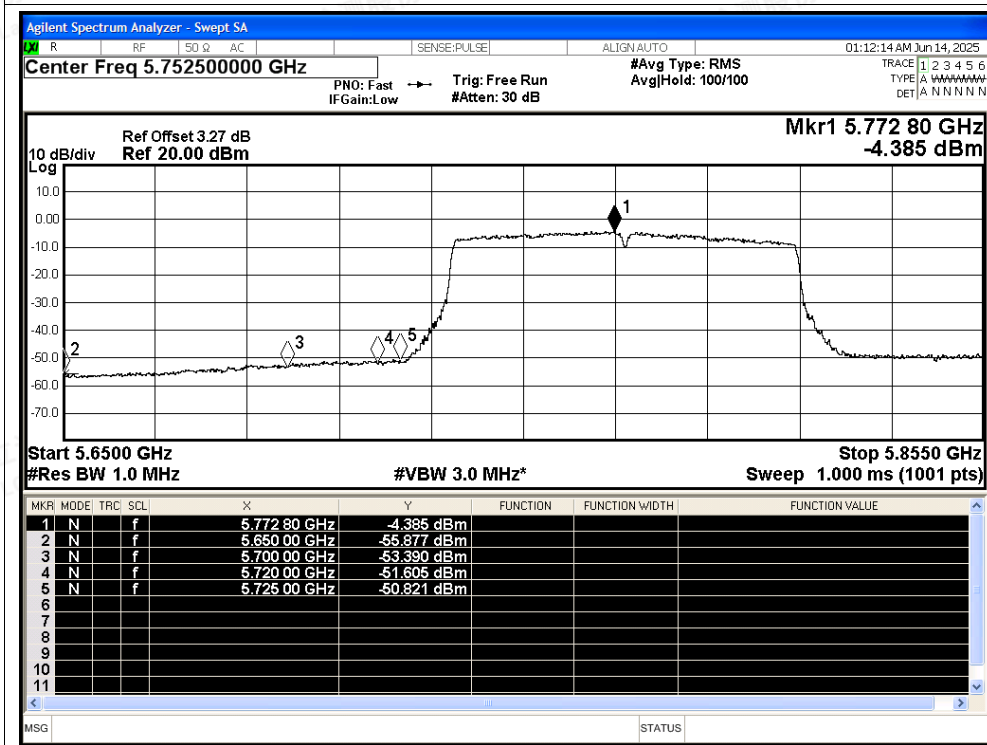

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

| Condition | Mode | Frequency (MHz) | Ant1 Power (dBm) | Ant2 Power (dBm) | SUM    | Gain (dBi) | EIRP Power (dBm) | Detector | Limit (dBm) | Verdict |
|-----------|------|-----------------|------------------|------------------|--------|------------|------------------|----------|-------------|---------|
| NVNT      | n20  | 5745            | -49.22           | -48.19           | -45.66 | 5.11       | -40.55           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5745            | -57              | -57.62           | -54.29 | 5.11       | -49.18           | Average  | -27         | Pass    |
| NVNT      | n20  | 5745            | -48.54           | -49.52           | -45.99 | 5.11       | -40.88           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5745            | -56.47           | -56.85           | -53.65 | 5.11       | -48.54           | Average  | 10          | Pass    |
| NVNT      | n20  | 5745            | -46.63           | -45.1            | -42.79 | 5.11       | -37.68           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5745            | -54.55           | -54.69           | -51.61 | 5.11       | -46.50           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5745            | -41.41           | -39.15           | -37.12 | 5.11       | -32.01           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5745            | -52.47           | -52.03           | -49.23 | 5.11       | -44.12           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | -46.62           | -44.32           | -42.31 | 5.11       | -37.20           | Peak     | 27          | Pass    |
| NVNT      | n20  | 5825            | -54.55           | -54.15           | -51.34 | 5.11       | -46.23           | Average  | 27          | Pass    |
| NVNT      | n20  | 5825            | -46.84           | -47.29           | -44.05 | 5.11       | -38.94           | Peak     | 15.6        | Pass    |
| NVNT      | n20  | 5825            | -55.27           | -55.29           | -52.27 | 5.11       | -47.16           | Average  | 15.6        | Pass    |
| NVNT      | n20  | 5825            | -48.74           | -48.53           | -45.62 | 5.11       | -40.51           | Peak     | 10          | Pass    |
| NVNT      | n20  | 5825            | -56.39           | -56.14           | -53.25 | 5.11       | -48.14           | Average  | 10          | Pass    |
| NVNT      | n20  | 5825            | -48.61           | -47.8            | -45.18 | 5.11       | -40.07           | Peak     | -27         | Pass    |
| NVNT      | n20  | 5825            | -56.38           | -56.65           | -53.50 | 5.11       | -48.39           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | -49.52           | -48.63           | -46.04 | 5.11       | -40.93           | Peak     | -27         | Pass    |
| NVNT      | n40  | 5755            | -57.1            | -56.65           | -53.86 | 5.11       | -48.75           | Average  | -27         | Pass    |
| NVNT      | n40  | 5755            | -47.43           | -47.91           | -44.65 | 5.11       | -39.54           | Peak     | 10          | Pass    |
| NVNT      | n40  | 5755            | -55.76           | -55.58           | -52.66 | 5.11       | -47.55           | Average  | 10          | Pass    |
| NVNT      | n40  | 5755            | -32.96           | -45.1            | -32.70 | 5.11       | -27.59           | Peak     | 15.6        | Pass    |
| NVNT      | n40  | 5755            | -53.65           | -54.27           | -50.94 | 5.11       | -45.83           | Average  | 15.6        | Pass    |
| NVNT      | n40  | 5755            | -43.75           | -43.78           | -40.75 | 5.11       | -35.64           | Peak     | 27          | Pass    |
| NVNT      | n40  | 5755            | -52.48           | -53.8            | -50.08 | 5.11       | -44.97           | Average  | 27          | Pass    |
| NVNT      | n40  | 5795            | -45.58           | -47.03           | -43.23 | 5.11       | -38.12           | Peak     | 27          | Pass    |
| NVNT      | n40  | 5795            | -55.23           | -55.85           | -52.52 | 5.11       | -47.41           | Average  | 27          | Pass    |
| NVNT      | n40  | 5795            | -47.1            | -48.16           | -44.59 | 5.11       | -39.48           | Peak     | 15.6        | Pass    |
| NVNT      | n40  | 5795            | -55.27           | -54.88           | -52.06 | 5.11       | -46.95           | Average  | 15.6        | Pass    |
| NVNT      | n40  | 5795            | -48.03           | -47.28           | -44.63 | 5.11       | -39.52           | Peak     | 10          | Pass    |
| NVNT      | n40  | 5795            | -56.37           | -56.64           | -53.49 | 5.11       | -48.38           | Average  | 10          | Pass    |
| NVNT      | n40  | 5795            | -47.19           | -49.43           | -45.16 | 5.11       | -40.05           | Peak     | -27         | Pass    |
| NVNT      | n40  | 5795            | -56.55           | -56.14           | -53.33 | 5.11       | -48.22           | Average  | -27         | Pass    |
| NVNT      | ac20 | 5745            | -48.62           | -49.34           | -45.95 | 5.11       | -40.84           | Peak     | -27         | Pass    |
| NVNT      | ac20 | 5745            | -57.07           | -57.23           | -54.14 | 5.11       | -49.03           | Average  | -27         | Pass    |
| NVNT      | ac20 | 5745            | -47.5            | -49.42           | -45.34 | 5.11       | -40.23           | Peak     | 10          | Pass    |
| NVNT      | ac20 | 5745            | -56.81           | -56.58           | -53.68 | 5.11       | -48.57           | Average  | 10          | Pass    |
| NVNT      | ac20 | 5745            | -46.42           | -45.63           | -43.00 | 5.11       | -37.89           | Peak     | 15.6        | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |        |      |        |         |      |      |
|------|------|------|--------|--------|--------|------|--------|---------|------|------|
| NVNT | ac20 | 5745 | -54.32 | -54.87 | -51.58 | 5.11 | -46.47 | Average | 15.6 | Pass |
| NVNT | ac20 | 5745 | -42.04 | -43.13 | -39.54 | 5.11 | -34.43 | Peak    | 27   | Pass |
| NVNT | ac20 | 5745 | -51.62 | -51.86 | -48.73 | 5.11 | -43.62 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | -46.35 | -47.02 | -43.66 | 5.11 | -38.55 | Peak    | 27   | Pass |
| NVNT | ac20 | 5825 | -55.14 | -54.31 | -51.69 | 5.11 | -46.58 | Average | 27   | Pass |
| NVNT | ac20 | 5825 | -47.9  | -44.11 | -42.59 | 5.11 | -37.48 | Peak    | 15.6 | Pass |
| NVNT | ac20 | 5825 | -55.48 | -56.04 | -52.74 | 5.11 | -47.63 | Average | 15.6 | Pass |
| NVNT | ac20 | 5825 | -49.31 | -49    | -46.14 | 5.11 | -41.03 | Peak    | 10   | Pass |
| NVNT | ac20 | 5825 | -56.47 | -56.78 | -53.61 | 5.11 | -48.50 | Average | 10   | Pass |
| NVNT | ac20 | 5825 | -47.21 | -49.61 | -45.24 | 5.11 | -40.13 | Peak    | -27  | Pass |
| NVNT | ac20 | 5825 | -56.74 | -56.29 | -53.50 | 5.11 | -48.39 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | -50.81 | -48.8  | -46.68 | 5.11 | -41.57 | Peak    | -27  | Pass |
| NVNT | ac40 | 5755 | -57.59 | -57.05 | -54.30 | 5.11 | -49.19 | Average | -27  | Pass |
| NVNT | ac40 | 5755 | -47.38 | -47.63 | -44.49 | 5.11 | -39.38 | Peak    | 10   | Pass |
| NVNT | ac40 | 5755 | -55.63 | -55.96 | -52.78 | 5.11 | -47.67 | Average | 10   | Pass |
| NVNT | ac40 | 5755 | -42.77 | -45.09 | -40.77 | 5.11 | -35.66 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5755 | -52.36 | -54.58 | -50.32 | 5.11 | -45.21 | Average | 15.6 | Pass |
| NVNT | ac40 | 5755 | -43.15 | -45.36 | -41.11 | 5.11 | -36.00 | Peak    | 27   | Pass |
| NVNT | ac40 | 5755 | -51.75 | -53.78 | -49.64 | 5.11 | -44.53 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | -46.62 | -47.37 | -43.97 | 5.11 | -38.86 | Peak    | 27   | Pass |
| NVNT | ac40 | 5795 | -55.64 | -54.86 | -52.22 | 5.11 | -47.11 | Average | 27   | Pass |
| NVNT | ac40 | 5795 | -42.57 | -47.64 | -41.39 | 5.11 | -36.28 | Peak    | 15.6 | Pass |
| NVNT | ac40 | 5795 | -55    | -55.7  | -52.33 | 5.11 | -47.22 | Average | 15.6 | Pass |
| NVNT | ac40 | 5795 | -48.61 | -48.31 | -45.45 | 5.11 | -40.34 | Peak    | 10   | Pass |
| NVNT | ac40 | 5795 | -56.12 | -56.64 | -53.36 | 5.11 | -48.25 | Average | 10   | Pass |
| NVNT | ac40 | 5795 | -48.88 | -47.94 | -45.37 | 5.11 | -40.26 | Peak    | -27  | Pass |
| NVNT | ac40 | 5795 | -56.83 | -56.62 | -53.71 | 5.11 | -48.60 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -41.38 | -39    | -37.02 | 5.11 | -31.91 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | -49.76 | -49.93 | -46.83 | 5.11 | -41.72 | Average | 27   | Pass |
| NVNT | ac80 | 5775 | -38.82 | -37.92 | -35.34 | 5.11 | -30.23 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | -49.95 | -49.31 | -46.61 | 5.11 | -41.50 | Average | 15.6 | Pass |
| NVNT | ac80 | 5775 | -43.78 | -42.16 | -39.88 | 5.11 | -34.77 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | -52.12 | -53.12 | -49.58 | 5.11 | -44.47 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | -48.24 | -48.54 | -45.38 | 5.11 | -40.27 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | -56.25 | -56.68 | -53.45 | 5.11 | -48.34 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -49.24 | -47.06 | -45.00 | 5.11 | -39.89 | Peak    | -27  | Pass |
| NVNT | ac80 | 5775 | -56.99 | -56.67 | -53.82 | 5.11 | -48.71 | Average | -27  | Pass |
| NVNT | ac80 | 5775 | -44.29 | -41.95 | -39.95 | 5.11 | -34.84 | Peak    | 10   | Pass |
| NVNT | ac80 | 5775 | -53    | -52.83 | -49.90 | 5.11 | -44.79 | Average | 10   | Pass |
| NVNT | ac80 | 5775 | -42.79 | -43.41 | -40.08 | 5.11 | -34.97 | Peak    | 15.6 | Pass |
| NVNT | ac80 | 5775 | -51.76 | -51.54 | -48.64 | 5.11 | -43.53 | Average | 15.6 | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |        |      |        |         |      |      |
|------|------|------|--------|--------|--------|------|--------|---------|------|------|
| NVNT | ac80 | 5775 | -42.48 | -39.29 | -37.59 | 5.11 | -32.48 | Peak    | 27   | Pass |
| NVNT | ac80 | 5775 | -51.43 | -51.12 | -48.26 | 5.11 | -43.15 | Average | 27   | Pass |
| NVNT | ax20 | 5745 | -48.83 | -49.18 | -45.99 | 5.11 | -40.88 | Peak    | -27  | Pass |
| NVNT | ax20 | 5745 | -56.91 | -57.61 | -54.24 | 5.11 | -49.13 | Average | -27  | Pass |
| NVNT | ax20 | 5745 | -48.32 | -48.1  | -45.20 | 5.11 | -40.09 | Peak    | 10   | Pass |
| NVNT | ax20 | 5745 | -56.49 | -56.85 | -53.66 | 5.11 | -48.55 | Average | 10   | Pass |
| NVNT | ax20 | 5745 | -47.03 | -47.36 | -44.18 | 5.11 | -39.07 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5745 | -54.36 | -54.54 | -51.44 | 5.11 | -46.33 | Average | 15.6 | Pass |
| NVNT | ax20 | 5745 | -39.61 | -43.26 | -38.05 | 5.11 | -32.94 | Peak    | 27   | Pass |
| NVNT | ax20 | 5745 | -51.45 | -51.32 | -48.37 | 5.11 | -43.26 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | -45.83 | -43.7  | -41.63 | 5.11 | -36.52 | Peak    | 27   | Pass |
| NVNT | ax20 | 5825 | -54.59 | -54.64 | -51.60 | 5.11 | -46.49 | Average | 27   | Pass |
| NVNT | ax20 | 5825 | -46.78 | -43.73 | -41.98 | 5.11 | -36.87 | Peak    | 15.6 | Pass |
| NVNT | ax20 | 5825 | -55.14 | -55.78 | -52.44 | 5.11 | -47.33 | Average | 15.6 | Pass |
| NVNT | ax20 | 5825 | -48.57 | -46.66 | -44.50 | 5.11 | -39.39 | Peak    | 10   | Pass |
| NVNT | ax20 | 5825 | -56.9  | -56.95 | -53.91 | 5.11 | -48.80 | Average | 10   | Pass |
| NVNT | ax20 | 5825 | -48.91 | -48.45 | -45.66 | 5.11 | -40.55 | Peak    | -27  | Pass |
| NVNT | ax20 | 5825 | -56.11 | -56.13 | -53.11 | 5.11 | -48.00 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | -48.79 | -47.08 | -44.84 | 5.11 | -39.73 | Peak    | -27  | Pass |
| NVNT | ax40 | 5755 | -57.34 | -57    | -54.16 | 5.11 | -49.05 | Average | -27  | Pass |
| NVNT | ax40 | 5755 | -46.89 | -47.2  | -44.03 | 5.11 | -38.92 | Peak    | 10   | Pass |
| NVNT | ax40 | 5755 | -55.86 | -55.33 | -52.58 | 5.11 | -47.47 | Average | 10   | Pass |
| NVNT | ax40 | 5755 | -44.72 | -46.86 | -42.65 | 5.11 | -37.54 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5755 | -52.37 | -54.32 | -50.23 | 5.11 | -45.12 | Average | 15.6 | Pass |
| NVNT | ax40 | 5755 | -41.55 | -45.06 | -39.95 | 5.11 | -34.84 | Peak    | 27   | Pass |
| NVNT | ax40 | 5755 | -50.54 | -53.74 | -48.84 | 5.11 | -43.73 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | -46.52 | -47.14 | -43.81 | 5.11 | -38.70 | Peak    | 27   | Pass |
| NVNT | ax40 | 5795 | -55.14 | -55.1  | -52.11 | 5.11 | -47.00 | Average | 27   | Pass |
| NVNT | ax40 | 5795 | -44.88 | -48.52 | -43.32 | 5.11 | -38.21 | Peak    | 15.6 | Pass |
| NVNT | ax40 | 5795 | -54.43 | -55.74 | -52.03 | 5.11 | -46.92 | Average | 15.6 | Pass |
| NVNT | ax40 | 5795 | -46.96 | -48.26 | -44.55 | 5.11 | -39.44 | Peak    | 10   | Pass |
| NVNT | ax40 | 5795 | -56.31 | -56.32 | -53.30 | 5.11 | -48.19 | Average | 10   | Pass |
| NVNT | ax40 | 5795 | -48.85 | -47.18 | -44.92 | 5.11 | -39.81 | Peak    | -27  | Pass |
| NVNT | ax40 | 5795 | -56.75 | -56.8  | -53.76 | 5.11 | -48.65 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | -39.33 | -38.42 | -35.84 | 5.11 | -30.73 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | -50.16 | -49.91 | -47.02 | 5.11 | -41.91 | Average | 27   | Pass |
| NVNT | ax80 | 5775 | -37.85 | -38.98 | -35.37 | 5.11 | -30.26 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | -49.43 | -50    | -46.70 | 5.11 | -41.59 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | -42.61 | -42.68 | -39.63 | 5.11 | -34.52 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | -52.6  | -52.75 | -49.66 | 5.11 | -44.55 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | -47.63 | -48.57 | -45.06 | 5.11 | -39.95 | Peak    | -27  | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



|      |      |      |        |        |        |      |        |         |      |      |
|------|------|------|--------|--------|--------|------|--------|---------|------|------|
| NVNT | ax80 | 5775 | -56.37 | -57.43 | -53.86 | 5.11 | -48.75 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | -48.93 | -48.59 | -45.75 | 5.11 | -40.64 | Peak    | -27  | Pass |
| NVNT | ax80 | 5775 | -56.83 | -55.88 | -53.32 | 5.11 | -48.21 | Average | -27  | Pass |
| NVNT | ax80 | 5775 | -43.53 | -44.06 | -40.78 | 5.11 | -35.67 | Peak    | 10   | Pass |
| NVNT | ax80 | 5775 | -53.12 | -53.39 | -50.24 | 5.11 | -45.13 | Average | 10   | Pass |
| NVNT | ax80 | 5775 | -41.67 | -41.49 | -38.57 | 5.11 | -33.46 | Peak    | 15.6 | Pass |
| NVNT | ax80 | 5775 | -52.2  | -51.61 | -48.88 | 5.11 | -43.77 | Average | 15.6 | Pass |
| NVNT | ax80 | 5775 | -42.12 | -40.44 | -38.19 | 5.11 | -33.08 | Peak    | 27   | Pass |
| NVNT | ax80 | 5775 | -51.18 | -50.82 | -47.99 | 5.11 | -42.88 | Average | 27   | Pass |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity





## G.5 Frequency Stability

| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant1    | 5744.92                  | -80000               | -13.93          | 25          | Pass    |
| NVNT      | a    | 5785            | Ant1    | 5784.9                   | -100000              | -17.29          | 25          | Pass    |
| NVNT      | a    | 5825            | Ant1    | 5824.92                  | -80000               | -13.73          | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 5744.94                  | -60000               | -10.44          | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 5784.92                  | -80000               | -13.83          | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 5824.9                   | -100000              | -17.17          | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 5754.92                  | -80000               | -13.9           | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 5794.92                  | -80000               | -13.81          | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 5744.92                  | -80000               | -13.93          | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 5784.92                  | -80000               | -13.83          | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 5824.92                  | -80000               | -13.73          | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 5754.88                  | -120000              | -20.85          | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 5794.92                  | -80000               | -13.81          | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant1    | 5774.92                  | -80000               | -13.85          | 25          | Pass    |
| NVNT      | ax20 | 5745            | Ant1    | 5744.9                   | -100000              | -17.41          | 25          | Pass    |
| NVNT      | ax20 | 5785            | Ant1    | 5784.92                  | -80000               | -13.83          | 25          | Pass    |
| NVNT      | ax20 | 5825            | Ant1    | 5824.9                   | -100000              | -17.17          | 25          | Pass    |
| NVNT      | ax40 | 5755            | Ant1    | 5754.88                  | -120000              | -20.85          | 25          | Pass    |
| NVNT      | ax40 | 5795            | Ant1    | 5794.92                  | -80000               | -13.81          | 25          | Pass    |
| NVNT      | ax80 | 5775            | Ant1    | 5774.92                  | -80000               | -13.85          | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity






## Test Graphs

## Freq. Stability NVNT a 5745MHz Ant1

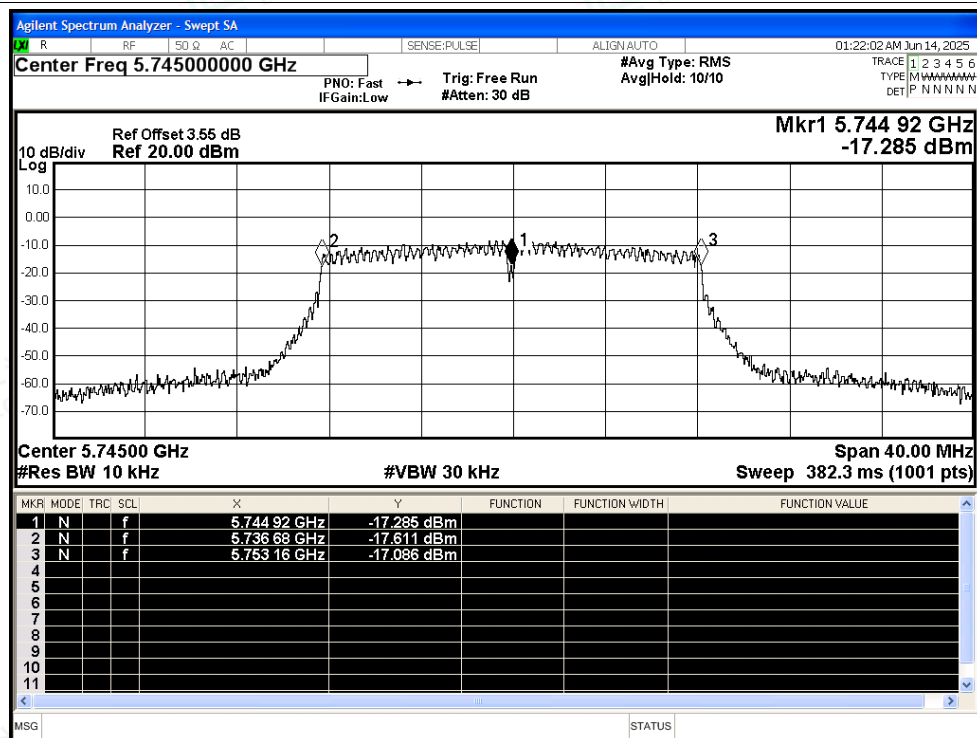

## Freq. Stability NVNT a 5785MHz Ant1

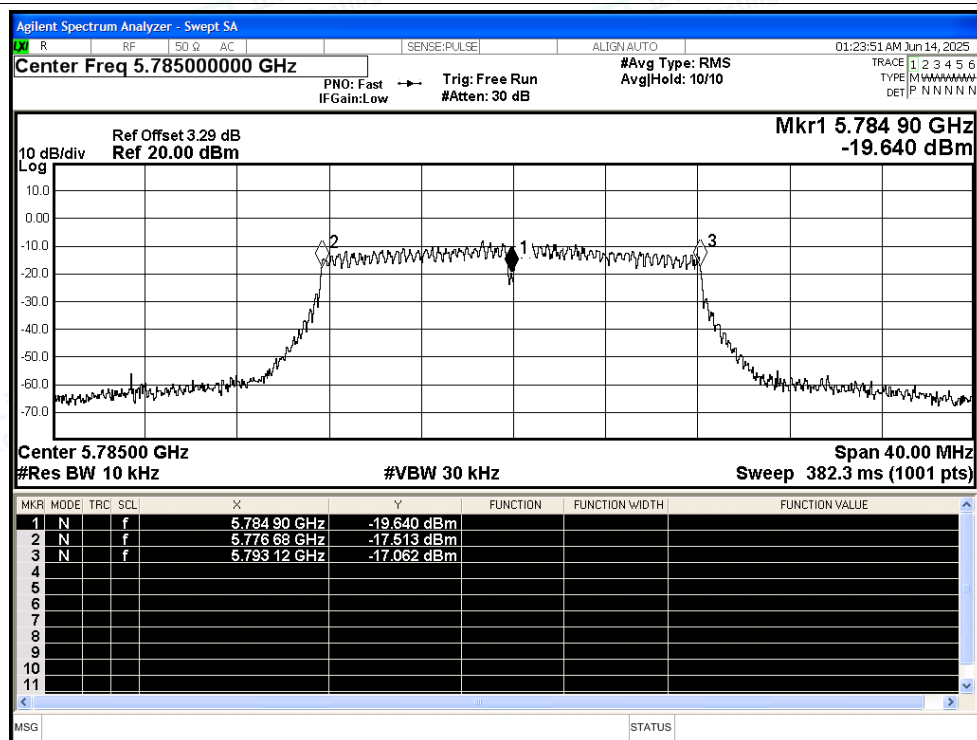

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5825MHz Ant1

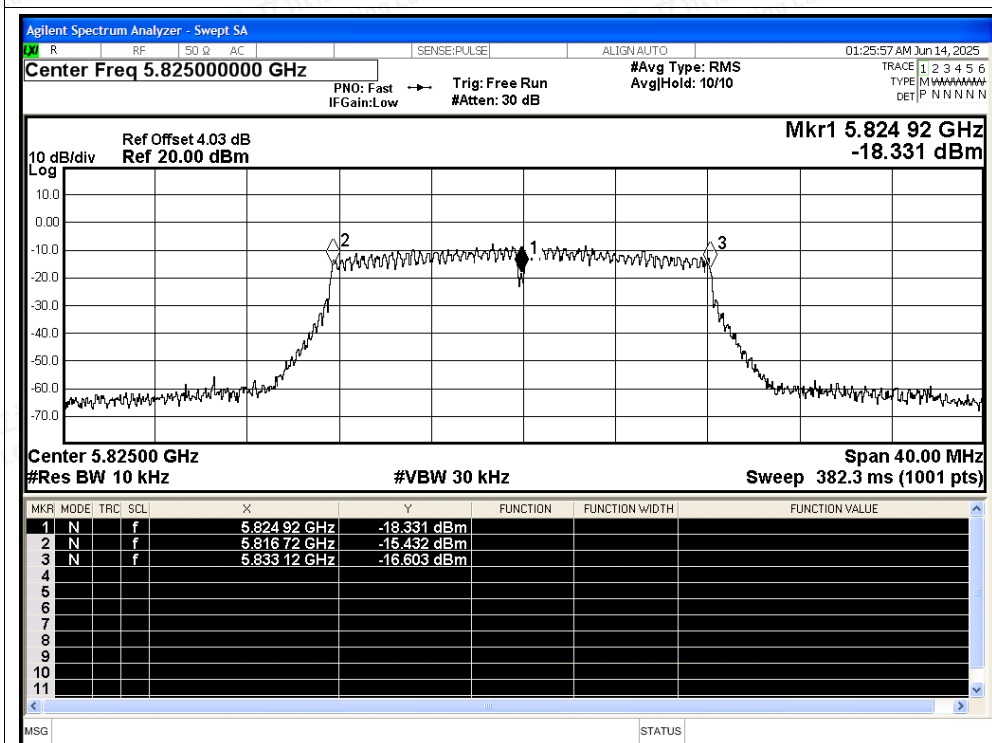

## Freq. Stability NVNT n20 5745MHz Ant1

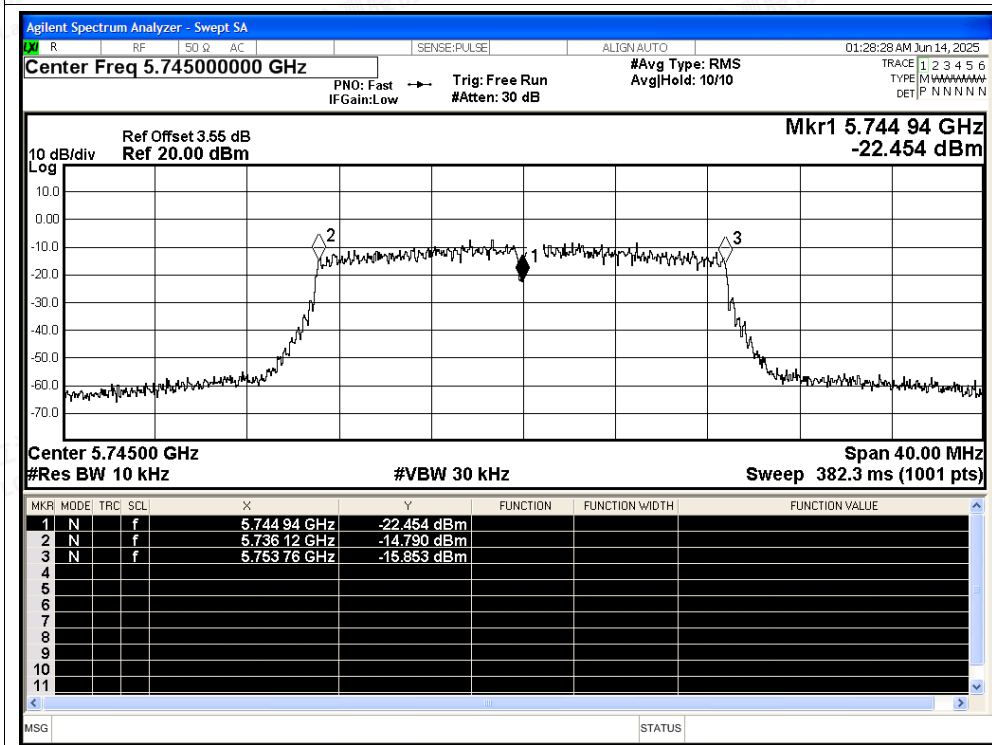

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n20 5785MHz Ant1

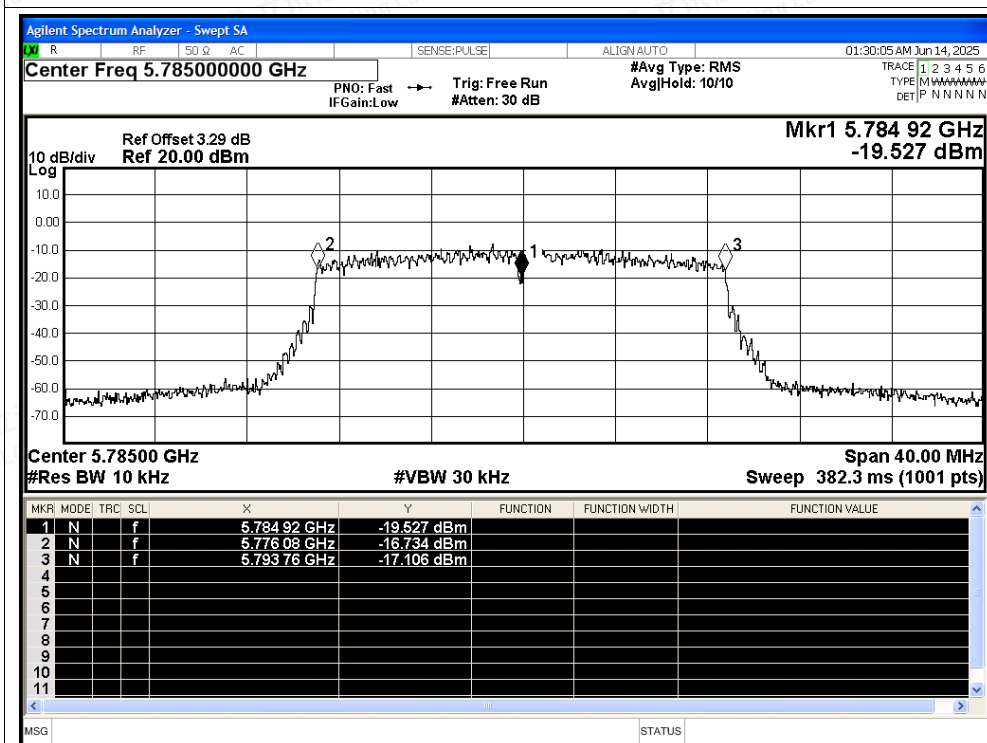

## Freq. Stability NVNT n20 5825MHz Ant1

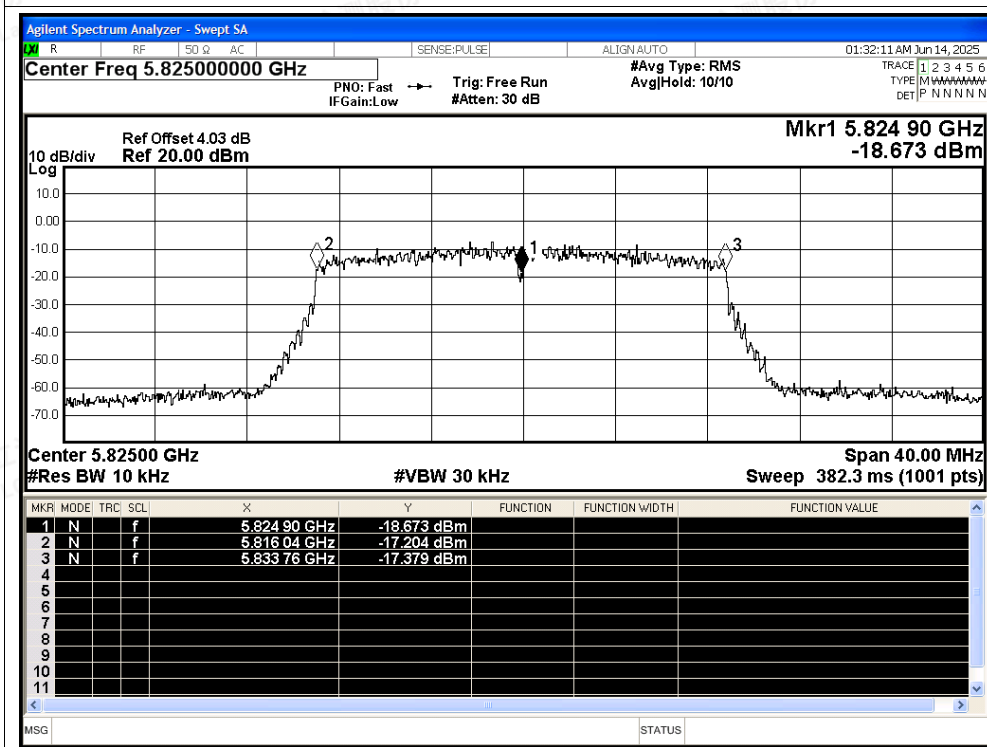

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5755MHz Ant1

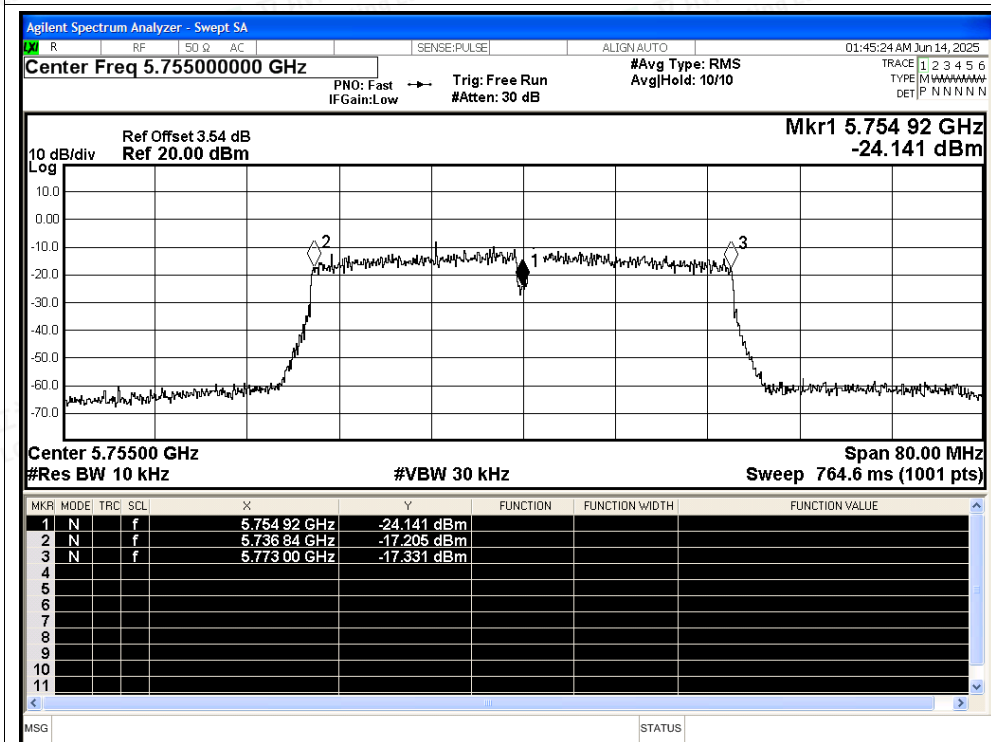

## Freq. Stability NVNT n40 5795MHz Ant1

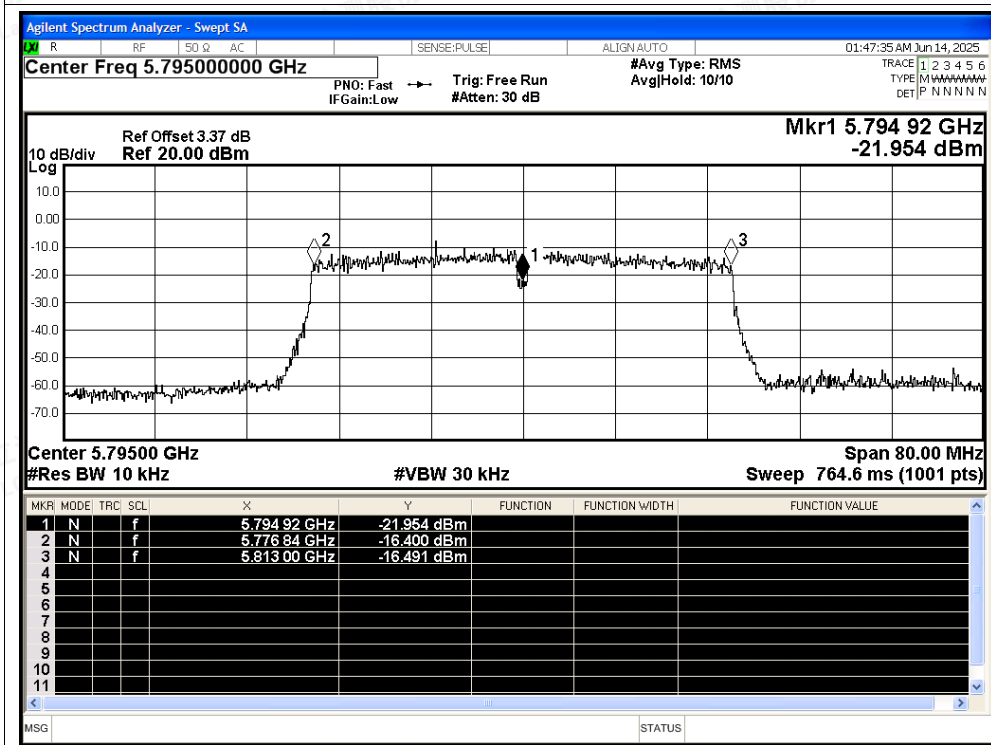

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5745MHz Ant1

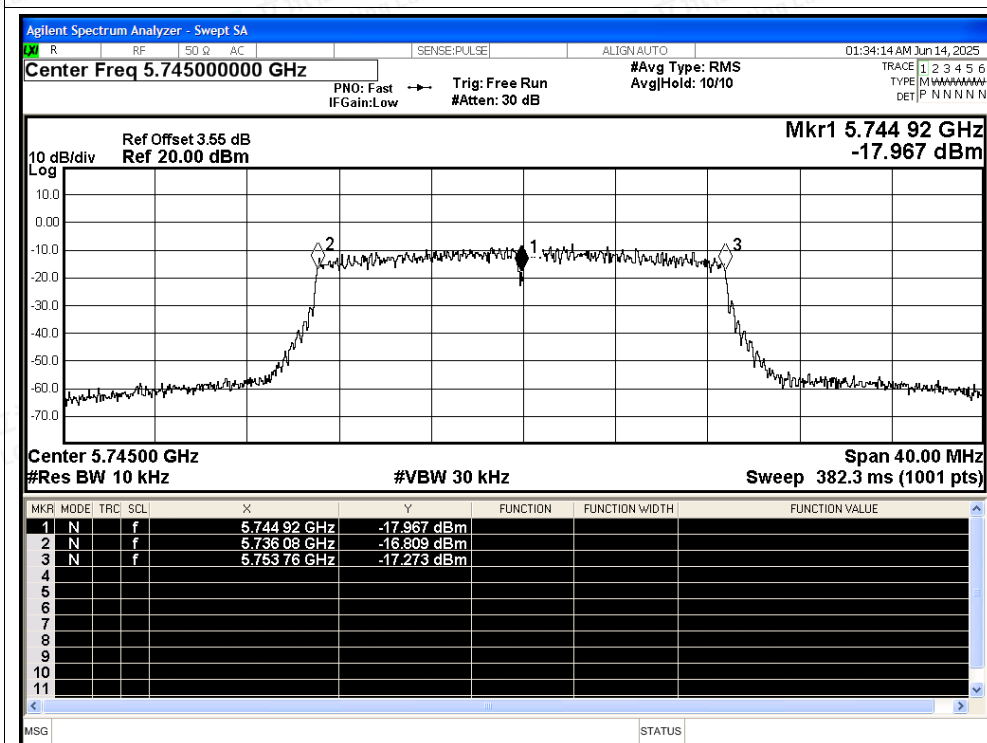

## Freq. Stability NVNT ac20 5785MHz Ant1

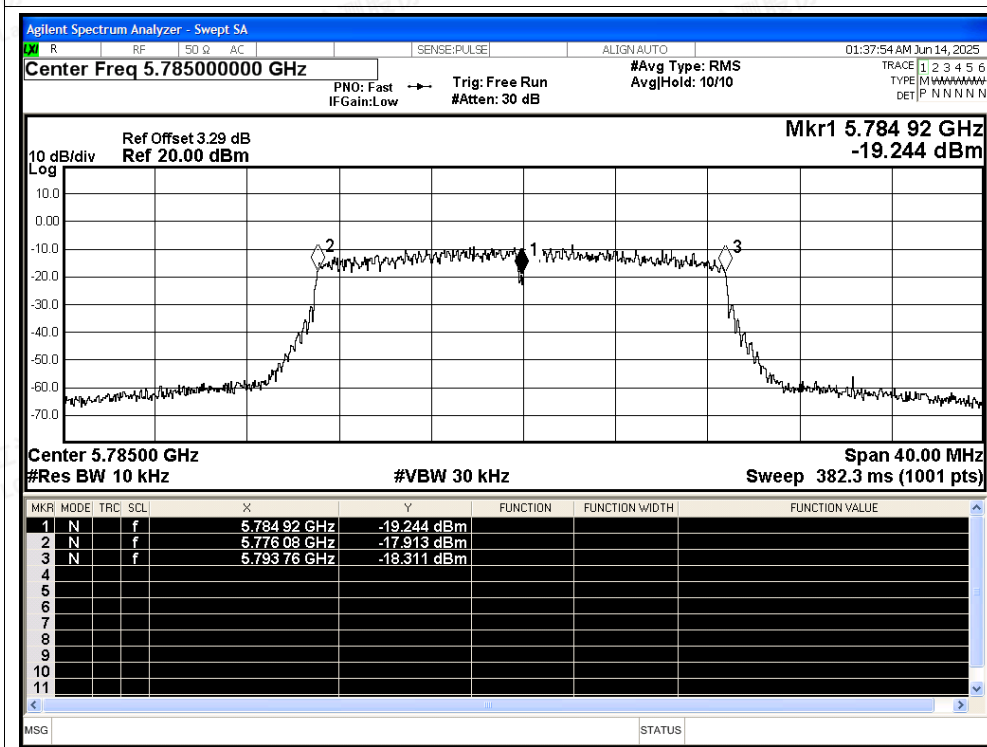

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5825MHz Ant1

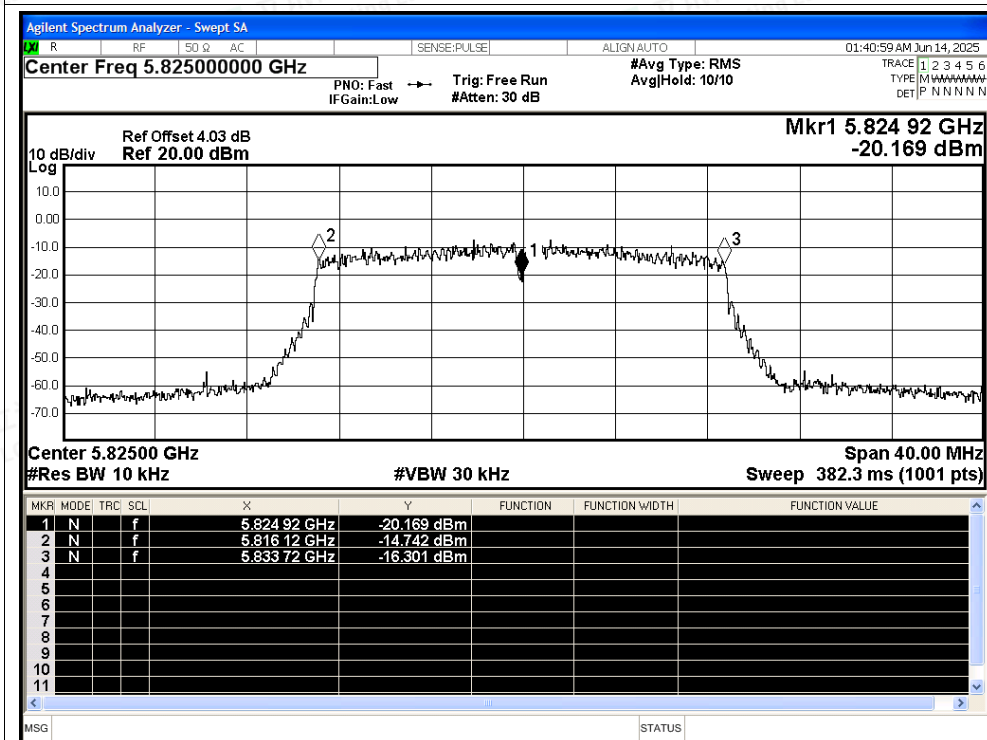

## Freq. Stability NVNT ac40 5755MHz Ant1

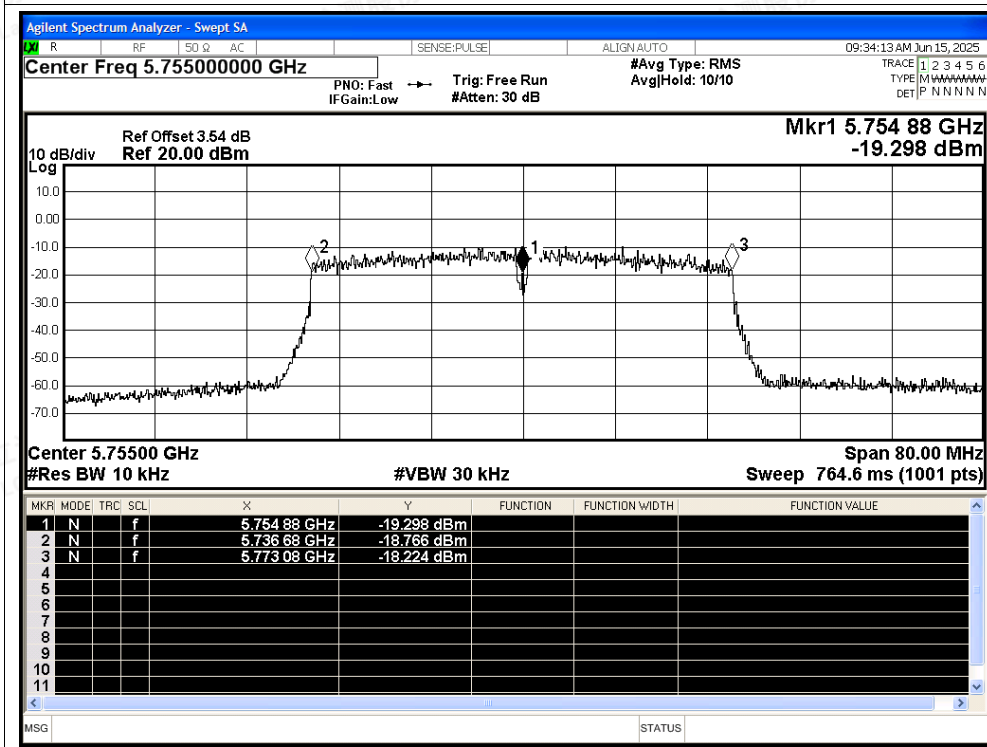

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ac40 5795MHz Ant1

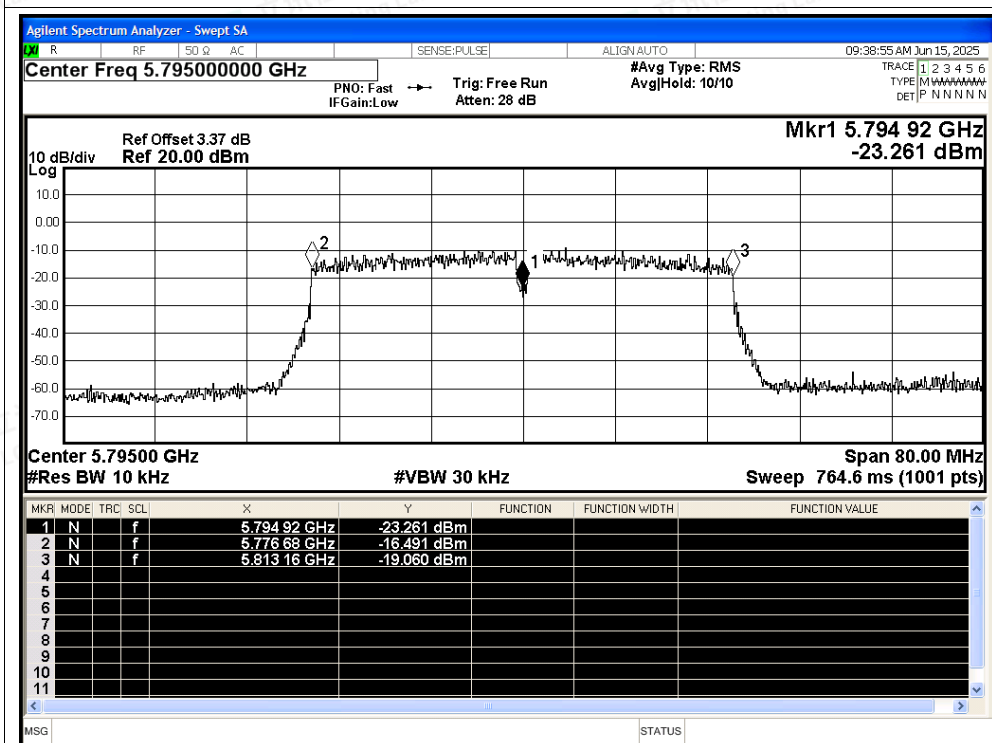

## Freq. Stability NVNT ac80 5775MHz Ant1

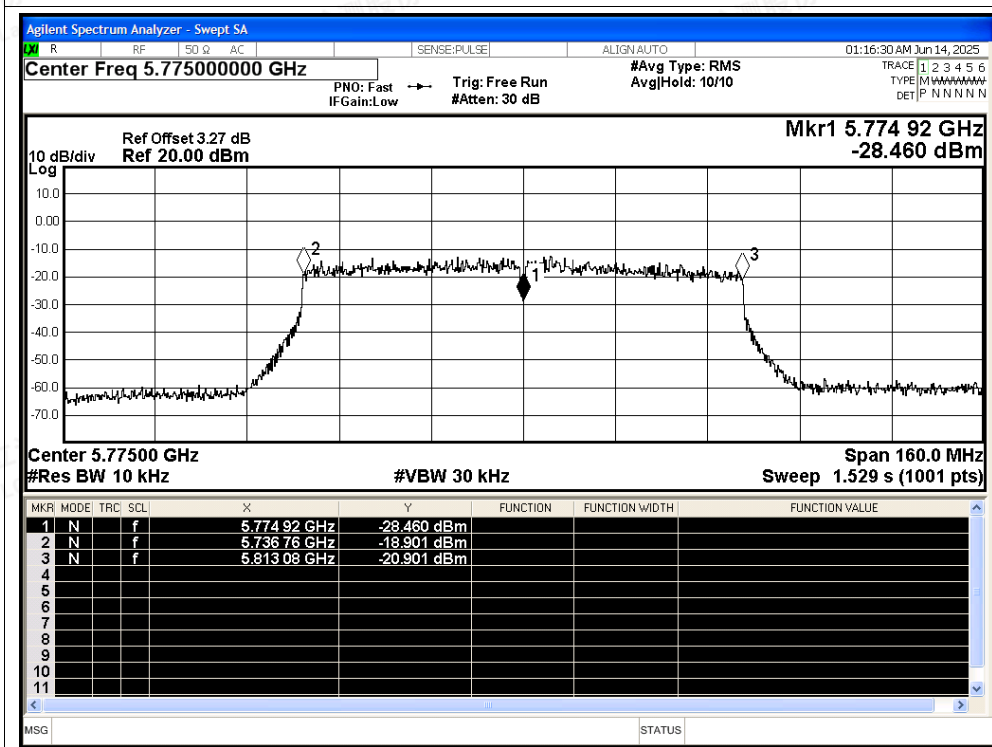

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5745MHz Ant1

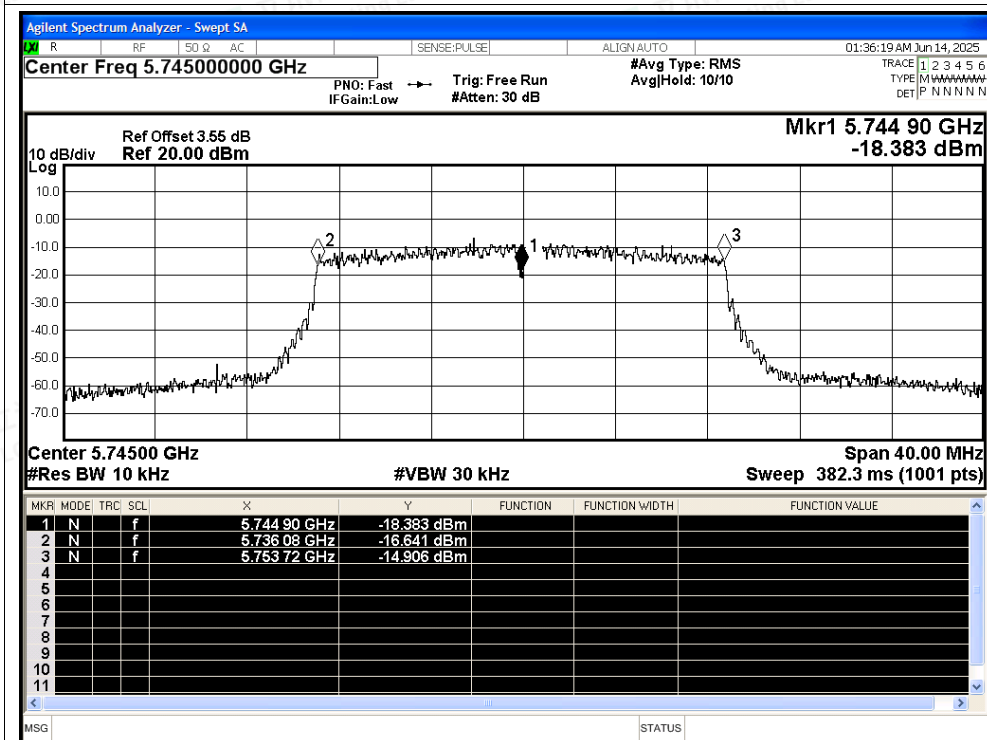

## Freq. Stability NVNT ax20 5785MHz Ant1

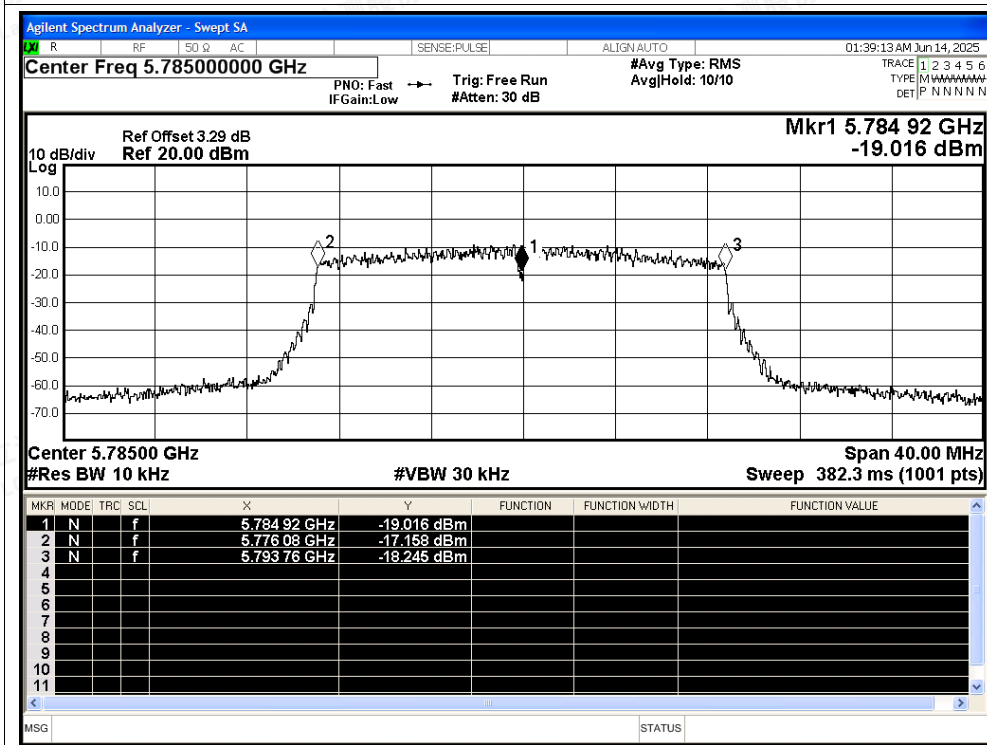

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5825MHz Ant1

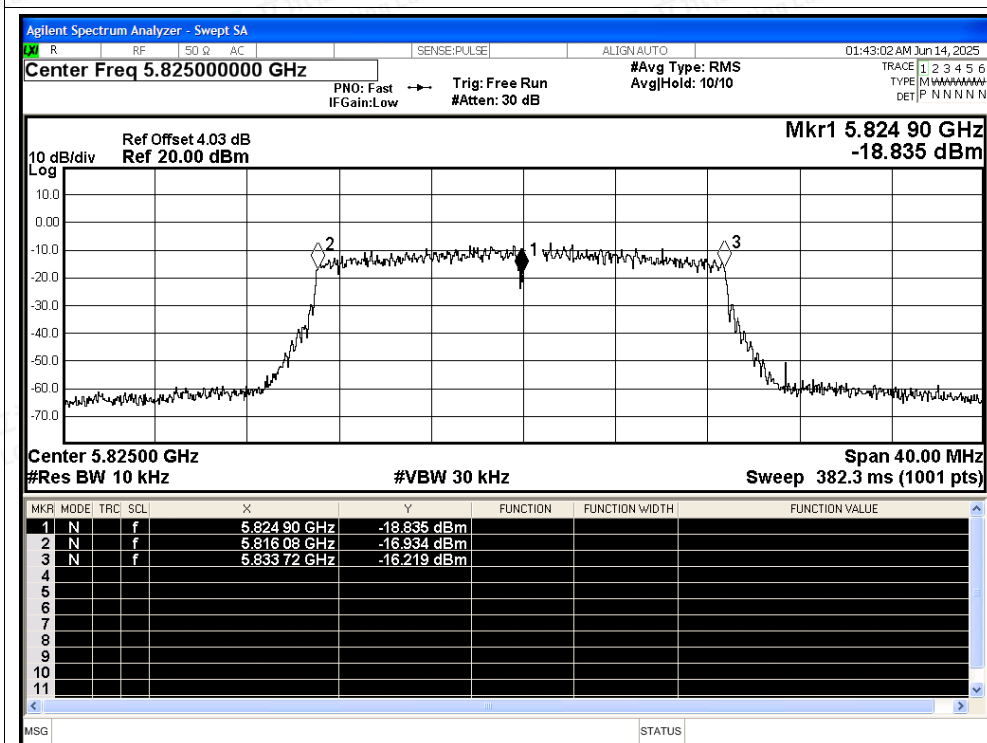

## Freq. Stability NVNT ax40 5755MHz Ant1

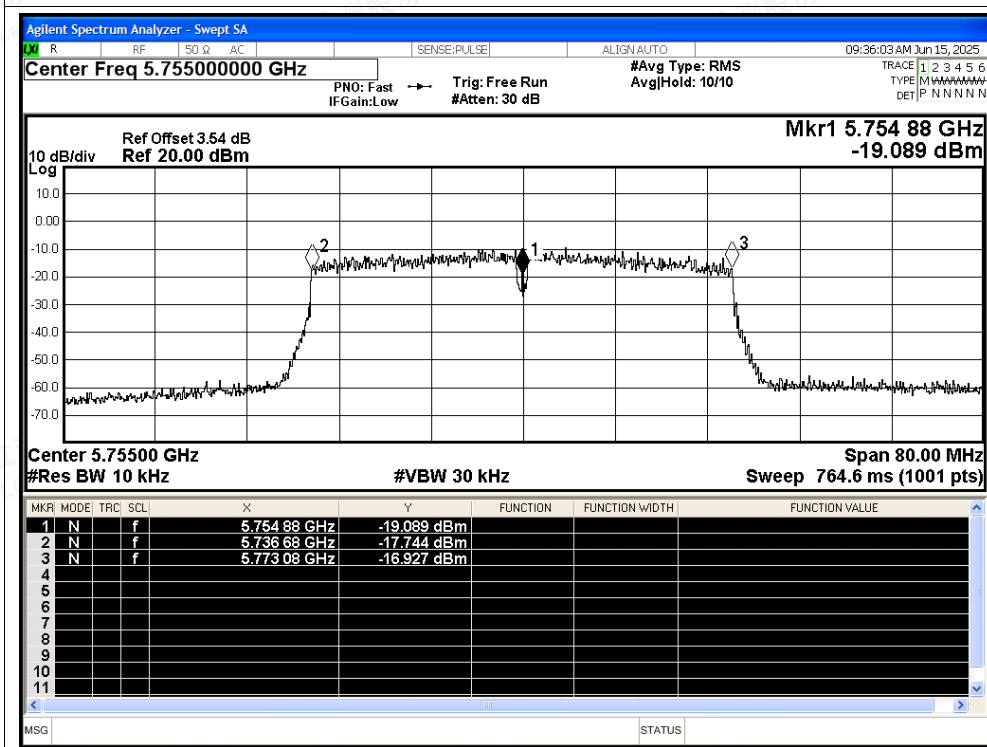

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax40 5795MHz Ant1

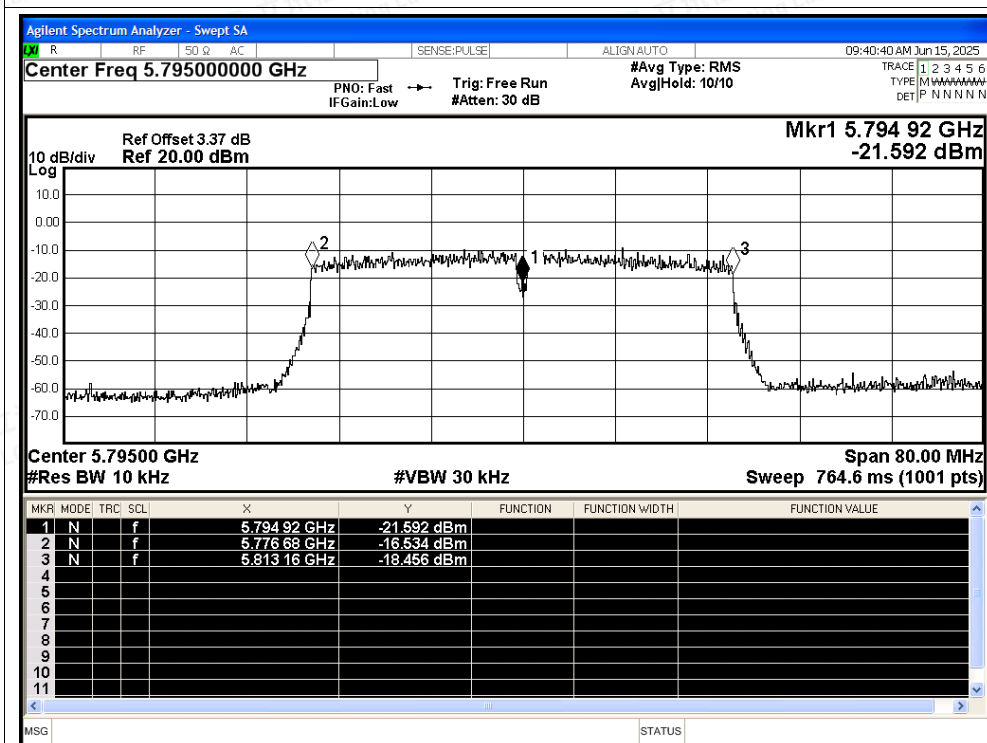

## Freq. Stability NVNT ax80 5775MHz Ant1

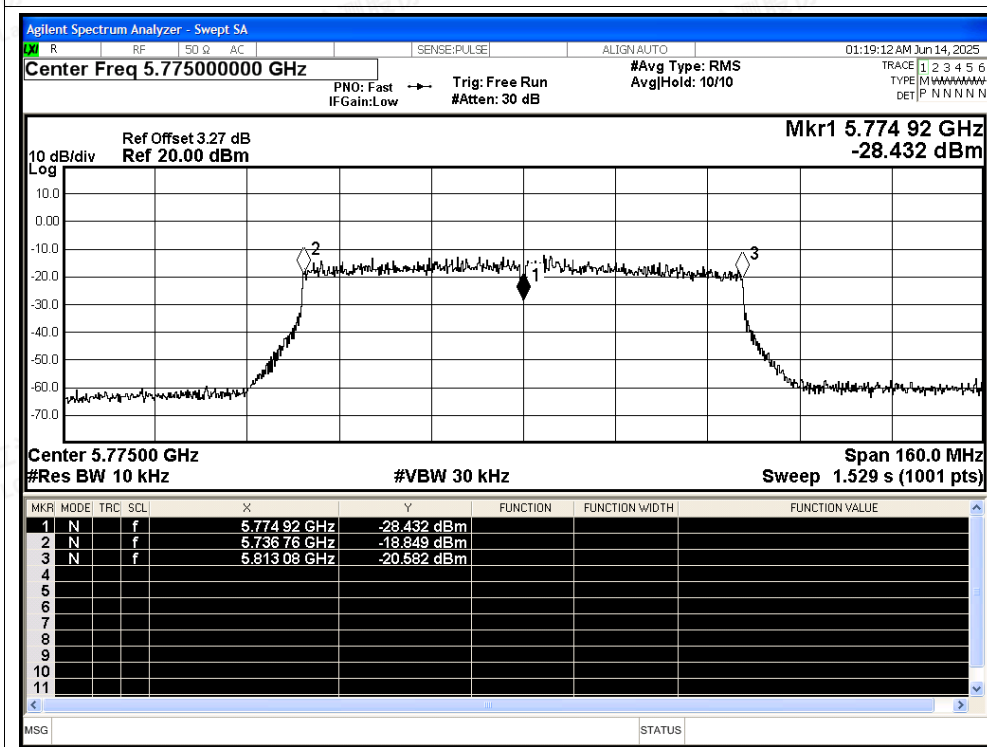

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



| Condition | Mode | Frequency (MHz) | Antenna | Measured Frequency (MHz) | Frequency Error (Hz) | Deviation (ppm) | Limit (ppm) | Verdict |
|-----------|------|-----------------|---------|--------------------------|----------------------|-----------------|-------------|---------|
| NVNT      | a    | 5745            | Ant2    | 5744.9                   | -100000              | -17.41          | 25          | Pass    |
| NVNT      | a    | 5785            | Ant2    | 5784.92                  | -80000               | -13.83          | 25          | Pass    |
| NVNT      | a    | 5825            | Ant2    | 5824.9                   | -100000              | -17.17          | 25          | Pass    |
| NVNT      | n20  | 5745            | Ant2    | 5744.92                  | -80000               | -13.93          | 25          | Pass    |
| NVNT      | n20  | 5785            | Ant2    | 5784.96                  | -40000               | -6.91           | 25          | Pass    |
| NVNT      | n20  | 5825            | Ant2    | 5824.94                  | -60000               | -10.3           | 25          | Pass    |
| NVNT      | n40  | 5755            | Ant2    | 5754.88                  | -120000              | -20.85          | 25          | Pass    |
| NVNT      | n40  | 5795            | Ant2    | 5794.88                  | -120000              | -20.71          | 25          | Pass    |
| NVNT      | ac20 | 5745            | Ant2    | 5744.92                  | -80000               | -13.93          | 25          | Pass    |
| NVNT      | ac20 | 5785            | Ant2    | 5784.88                  | -120000              | -20.74          | 25          | Pass    |
| NVNT      | ac20 | 5825            | Ant2    | 5824.92                  | -80000               | -13.73          | 25          | Pass    |
| NVNT      | ac40 | 5755            | Ant2    | 5754.88                  | -120000              | -20.85          | 25          | Pass    |
| NVNT      | ac40 | 5795            | Ant2    | 5794.92                  | -80000               | -13.81          | 25          | Pass    |
| NVNT      | ac80 | 5775            | Ant2    | 5774.92                  | -80000               | -13.85          | 25          | Pass    |
| NVNT      | ax20 | 5745            | Ant2    | 5744.92                  | -80000               | -13.93          | 25          | Pass    |
| NVNT      | ax20 | 5785            | Ant2    | 5784.9                   | -100000              | -17.29          | 25          | Pass    |
| NVNT      | ax20 | 5825            | Ant2    | 5824.92                  | -80000               | -13.73          | 25          | Pass    |
| NVNT      | ax40 | 5755            | Ant2    | 5754.88                  | -120000              | -20.85          | 25          | Pass    |
| NVNT      | ax40 | 5795            | Ant2    | 5794.88                  | -120000              | -20.71          | 25          | Pass    |
| NVNT      | ax80 | 5775            | Ant2    | 5774.92                  | -80000               | -13.85          | 25          | Pass    |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Freq. Stability NVNT a 5745MHz Ant2

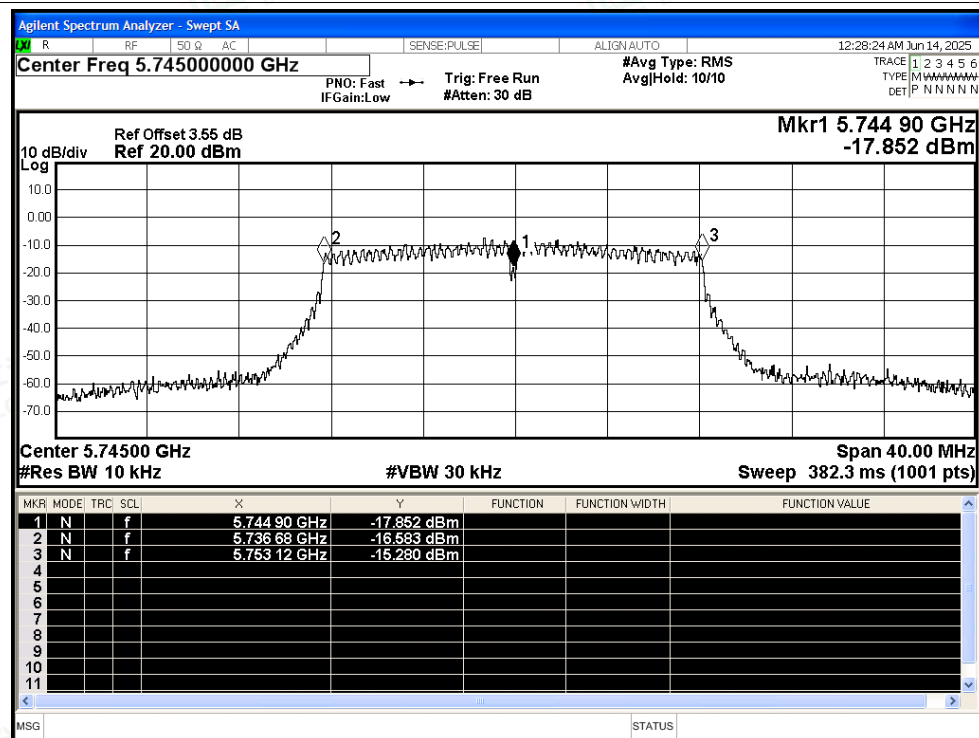

## Freq. Stability NVNT a 5785MHz Ant2

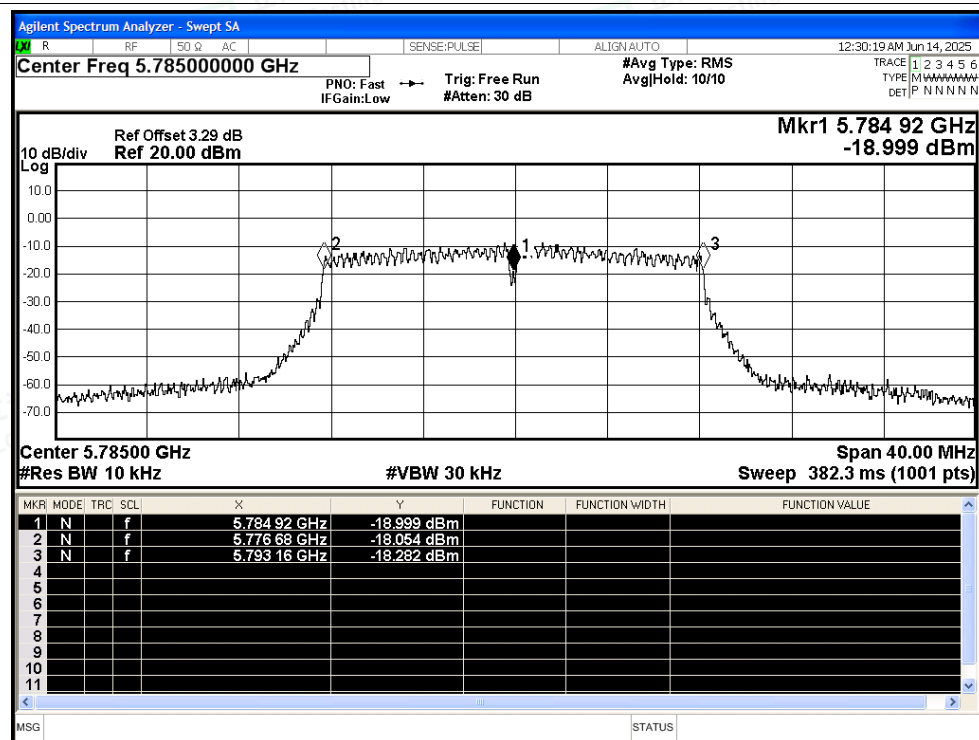

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT a 5825MHz Ant2

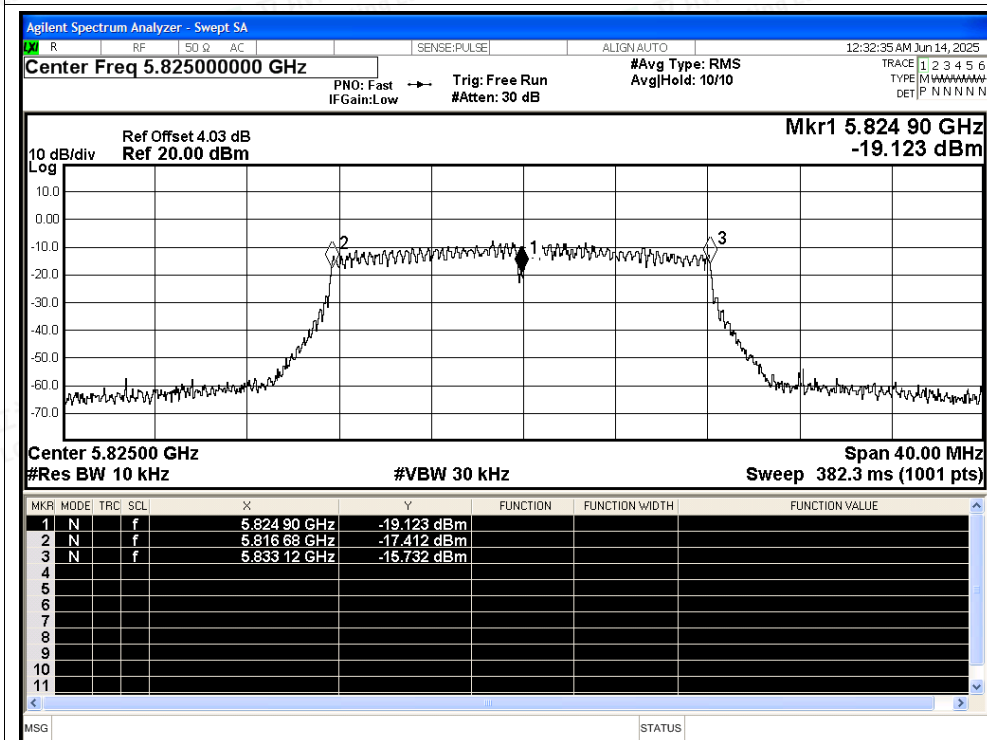

## Freq. Stability NVNT n20 5745MHz Ant2

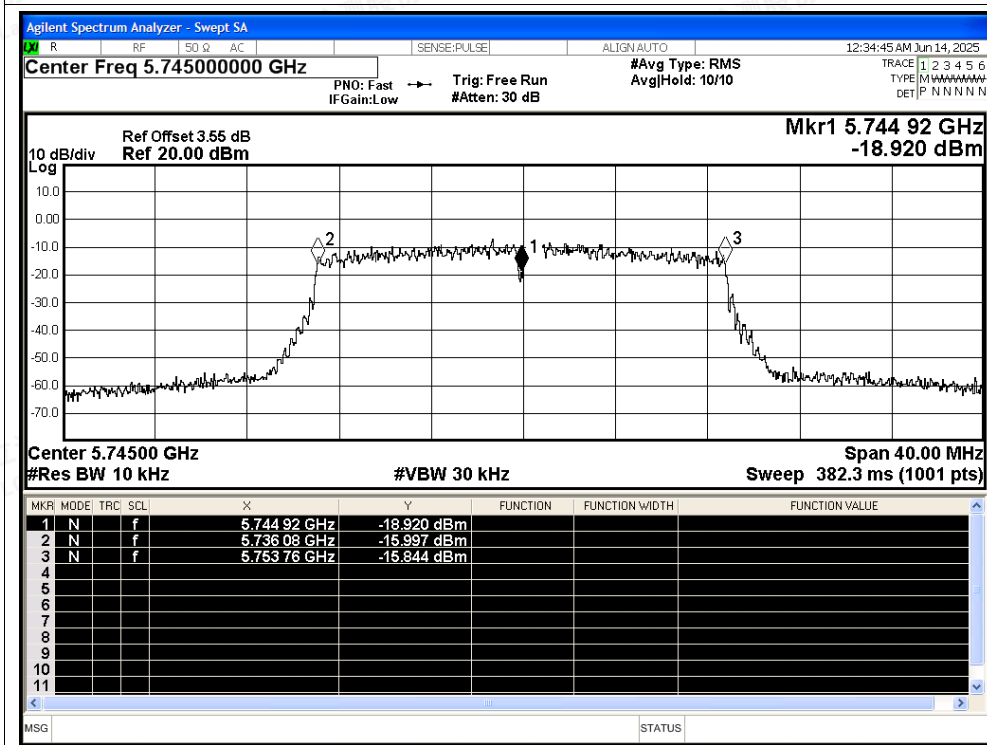

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT n20 5785MHz Ant2

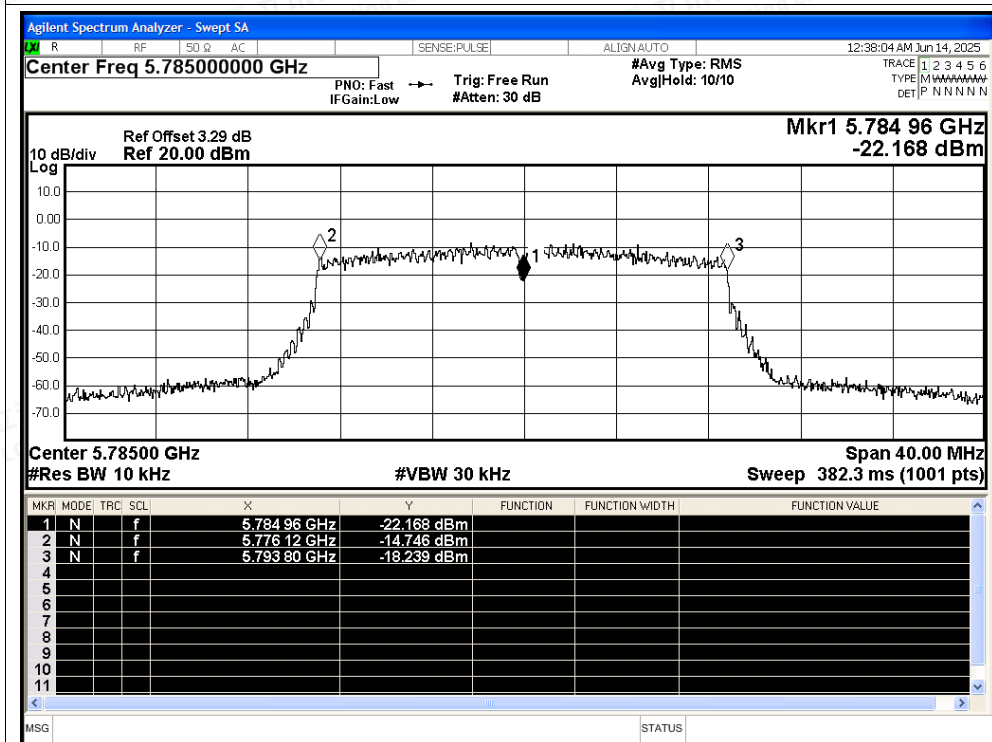

## Freq. Stability NVNT n20 5825MHz Ant2

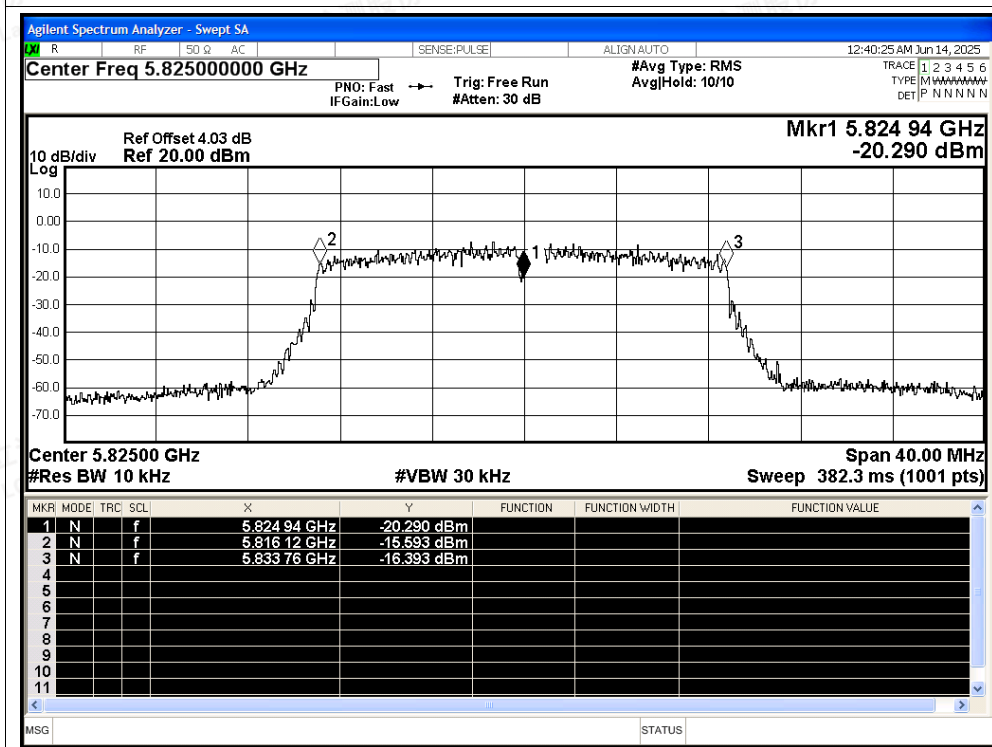

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT n40 5755MHz Ant2

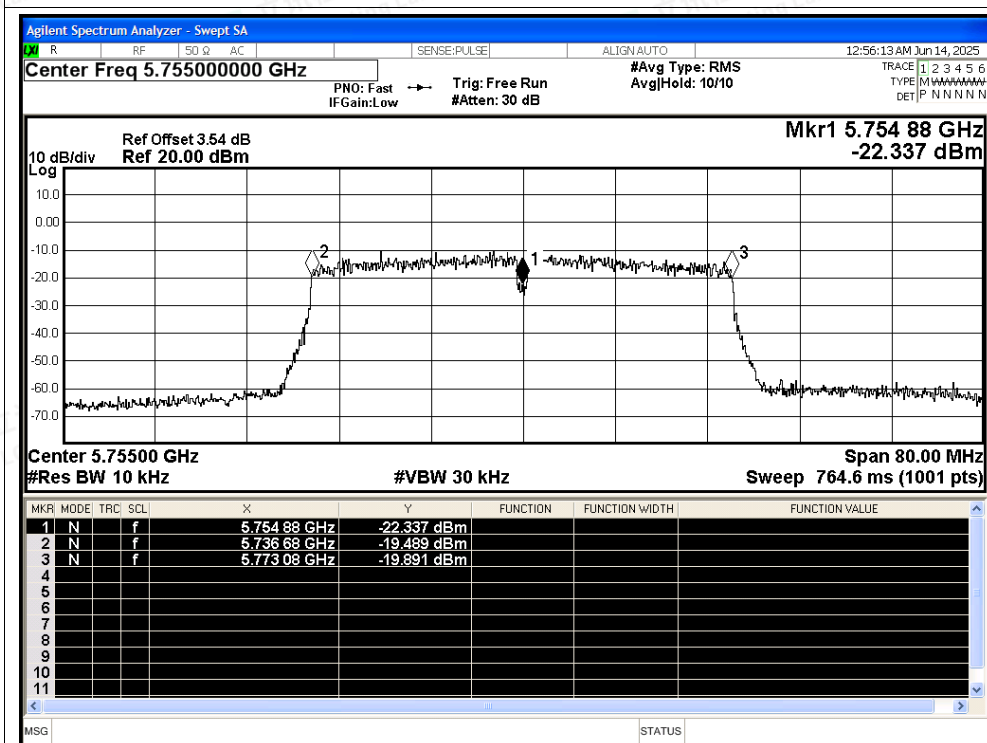

## Freq. Stability NVNT n40 5795MHz Ant2

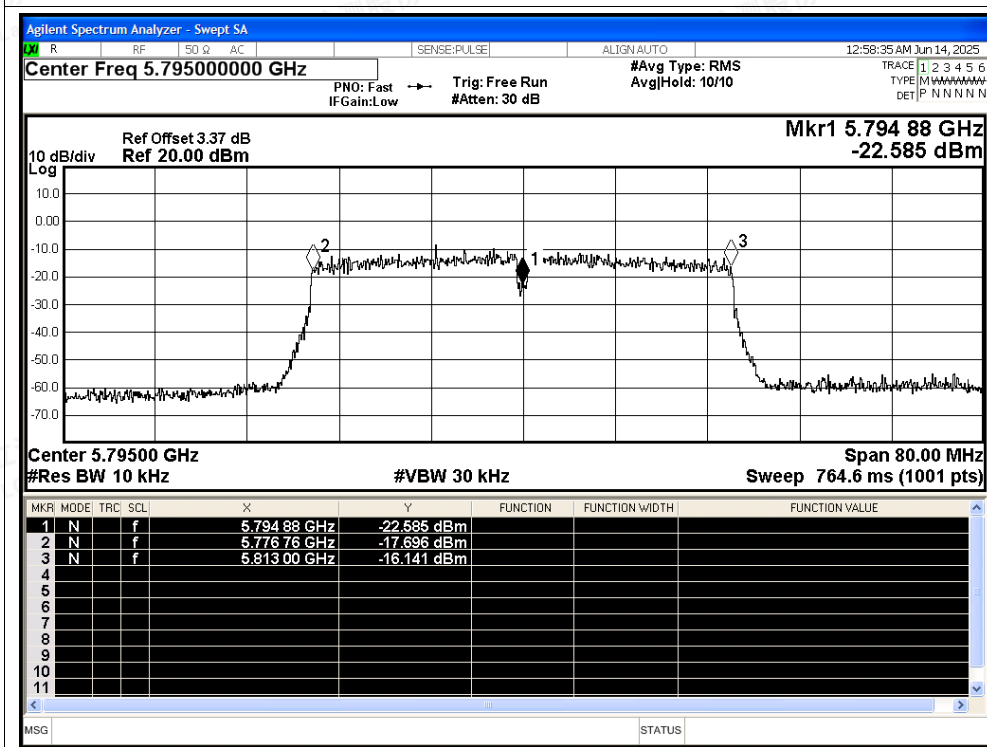

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5745MHz Ant2

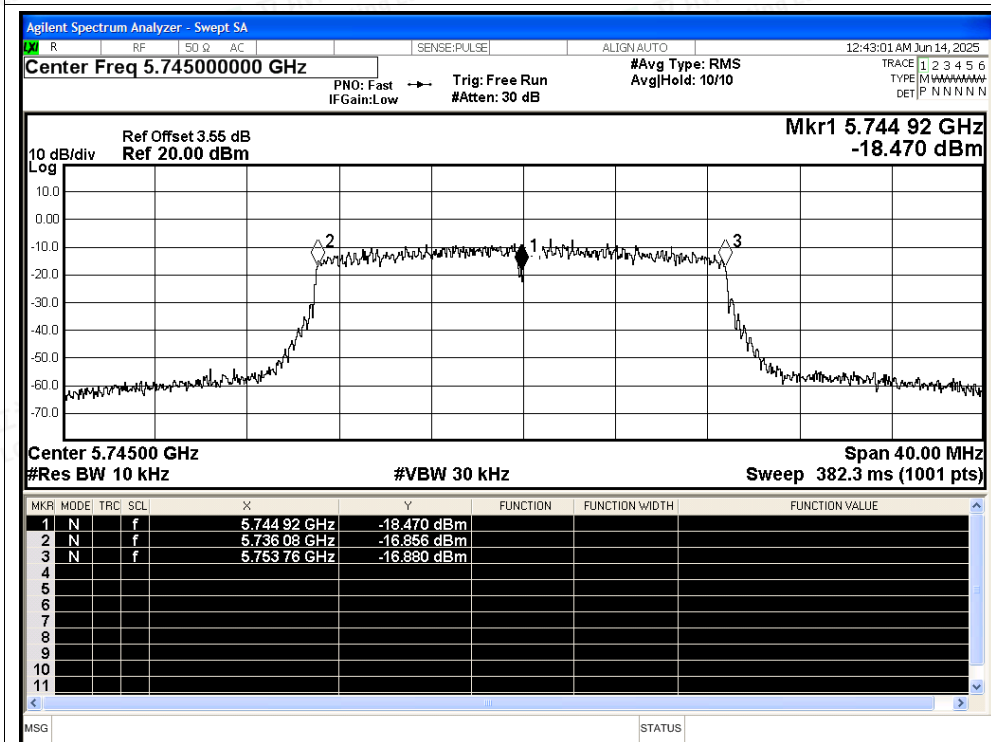

## Freq. Stability NVNT ac20 5785MHz Ant2

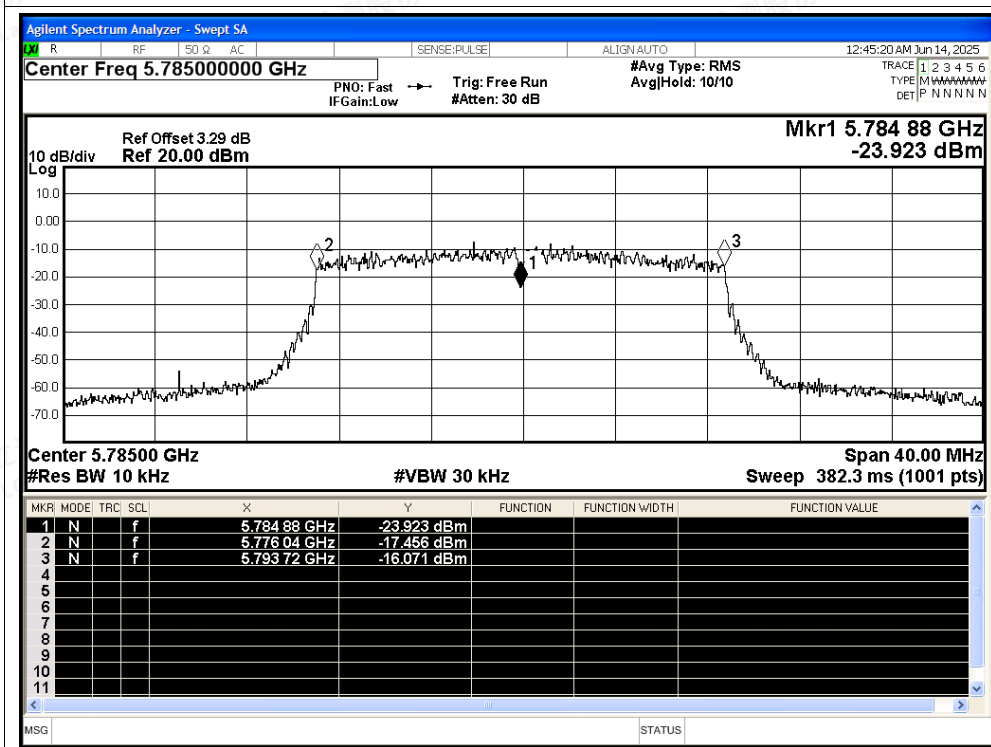

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac20 5825MHz Ant2

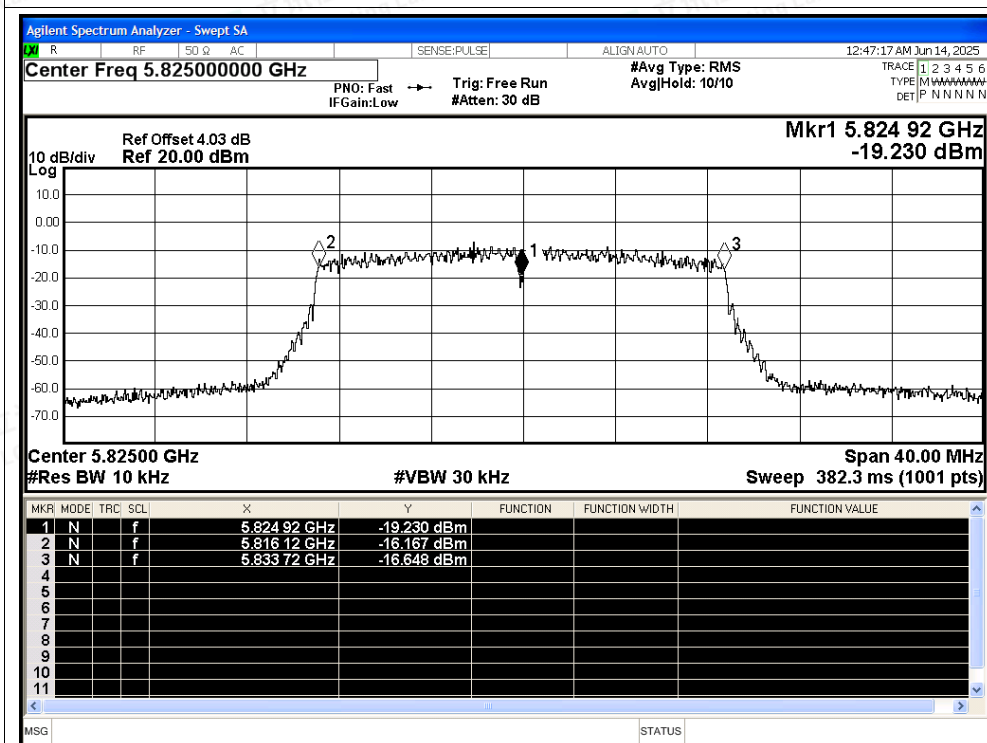

## Freq. Stability NVNT ac40 5755MHz Ant2

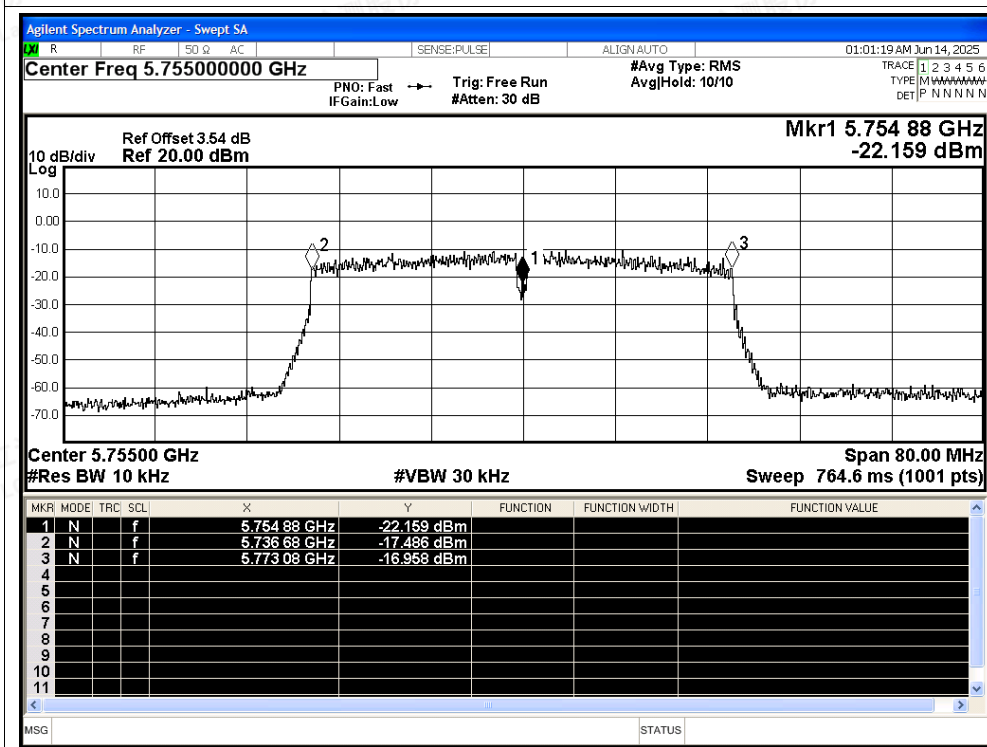

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ac40 5795MHz Ant2

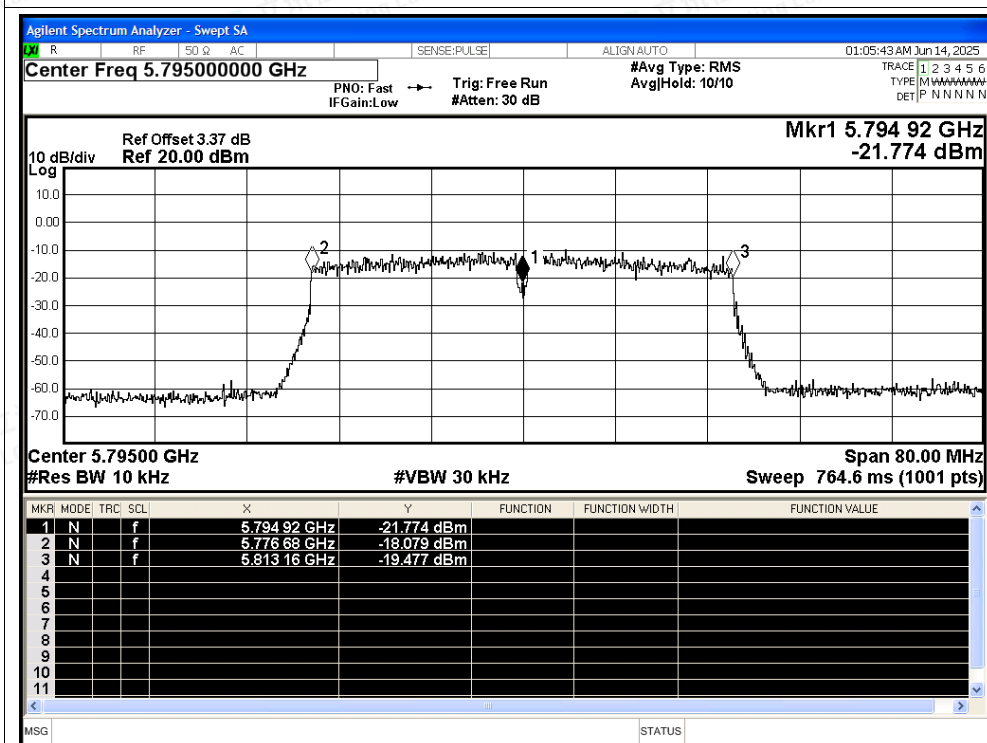

## Freq. Stability NVNT ac80 5775MHz Ant2

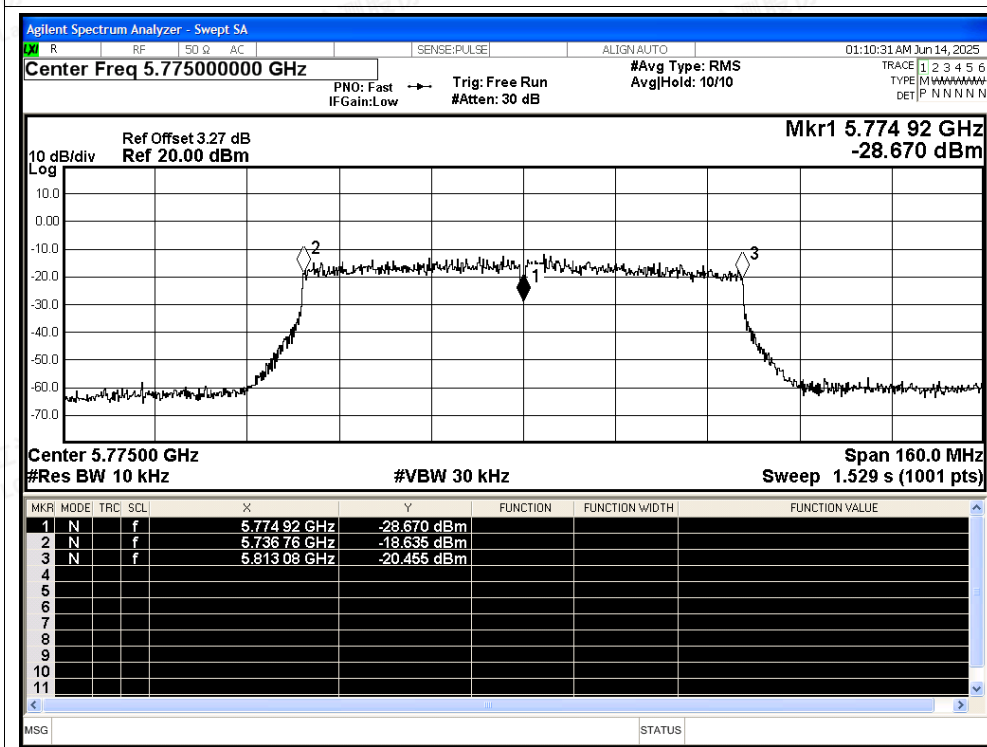

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5745MHz Ant2

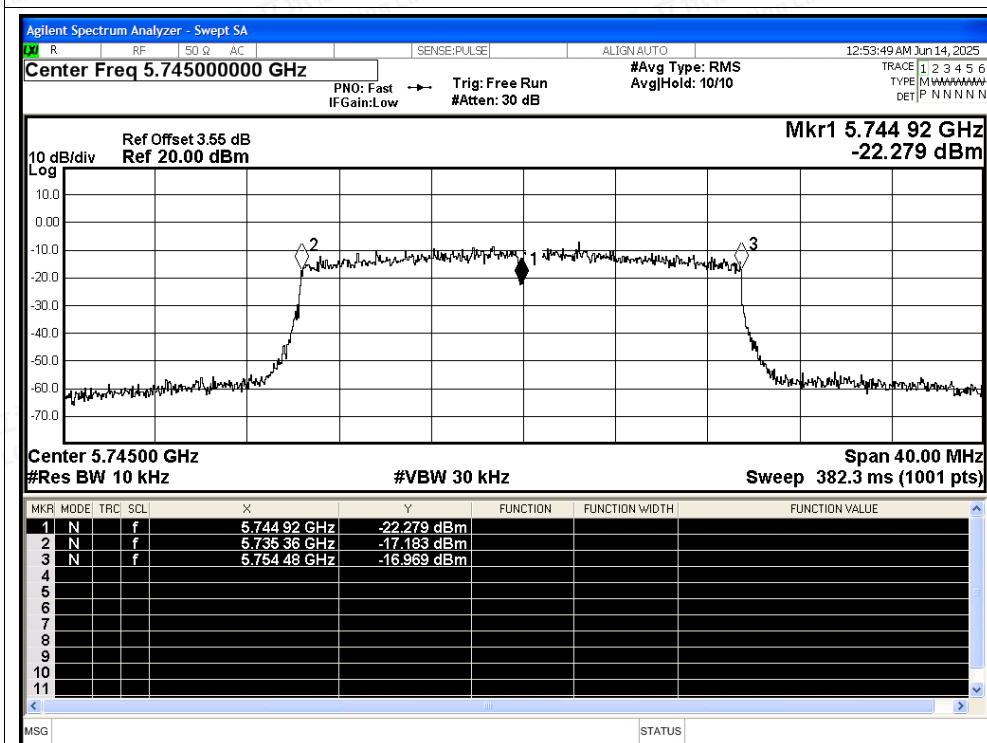

## Freq. Stability NVNT ax20 5785MHz Ant2

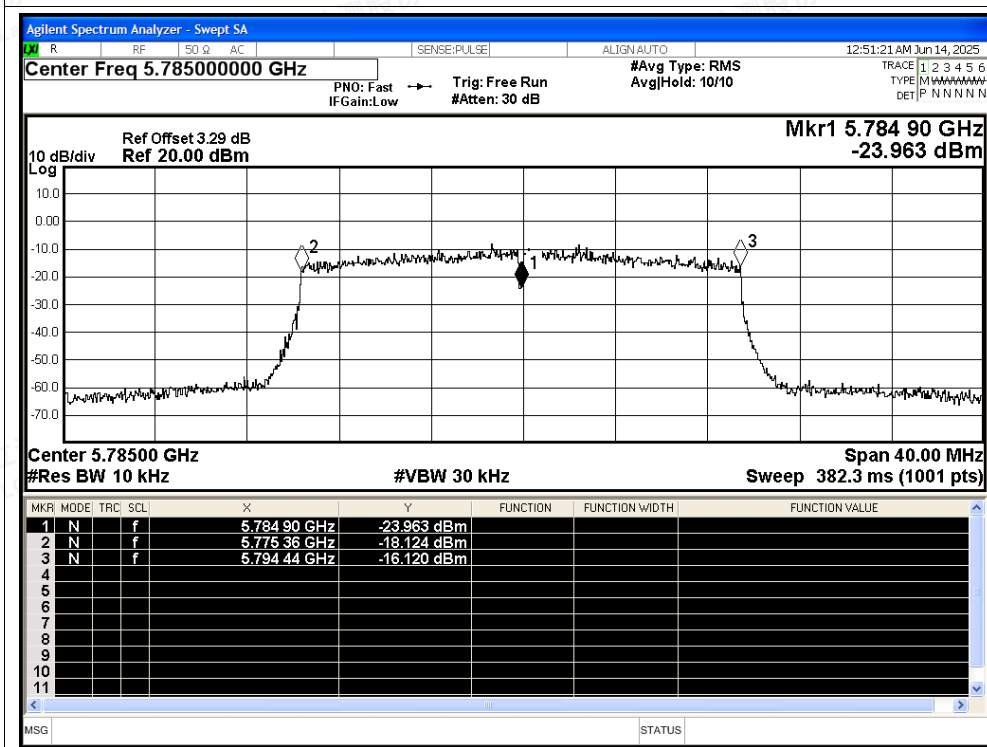

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Freq. Stability NVNT ax20 5825MHz Ant2

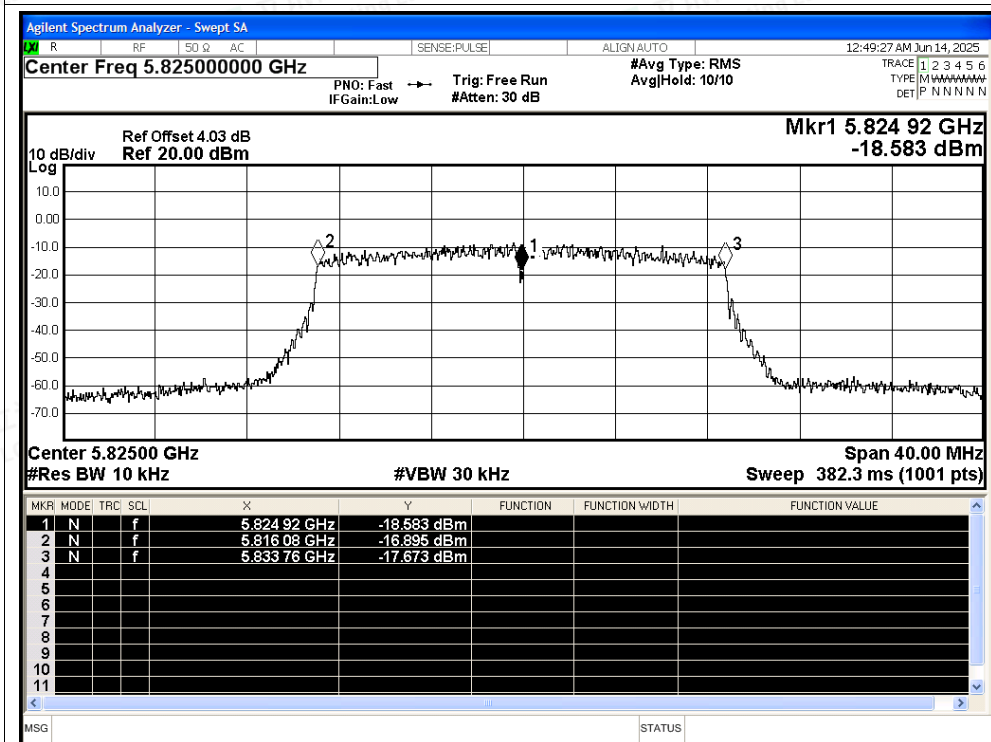

## Freq. Stability NVNT ax40 5755MHz Ant2

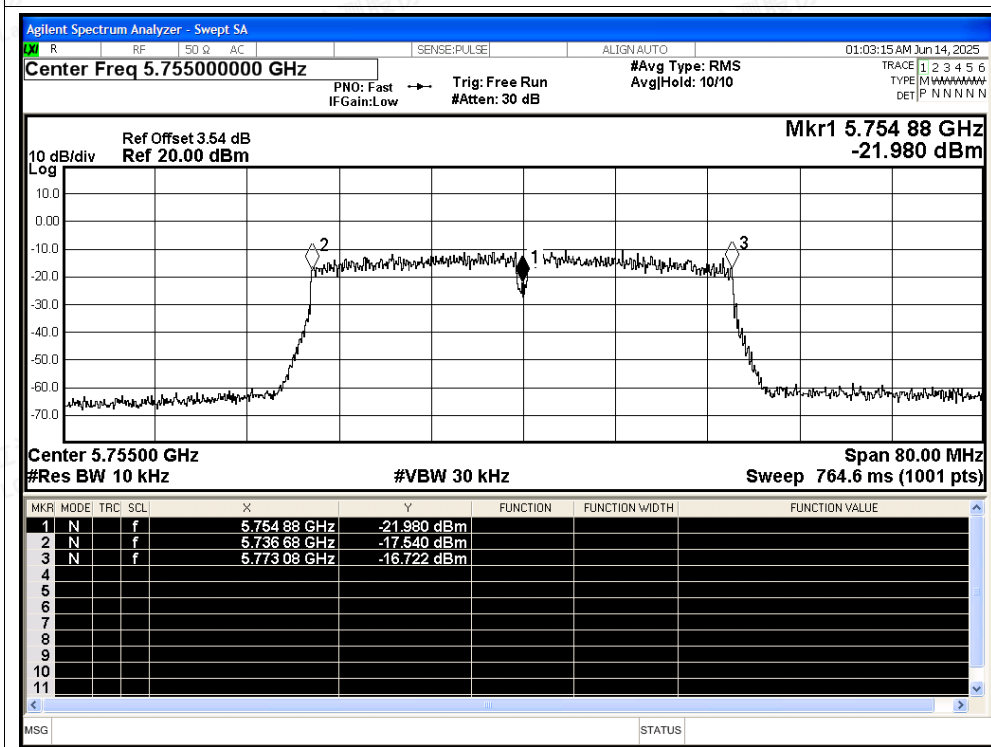

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Freq. Stability NVNT ax40 5795MHz Ant2

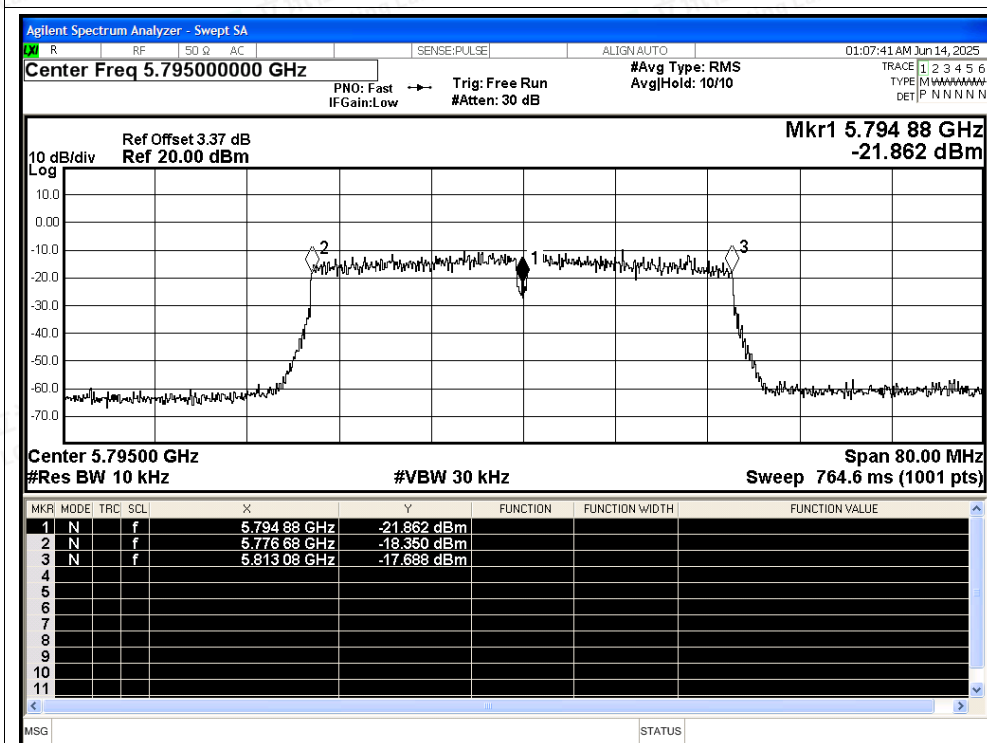

## Freq. Stability NVNT ax80 5775MHz Ant2

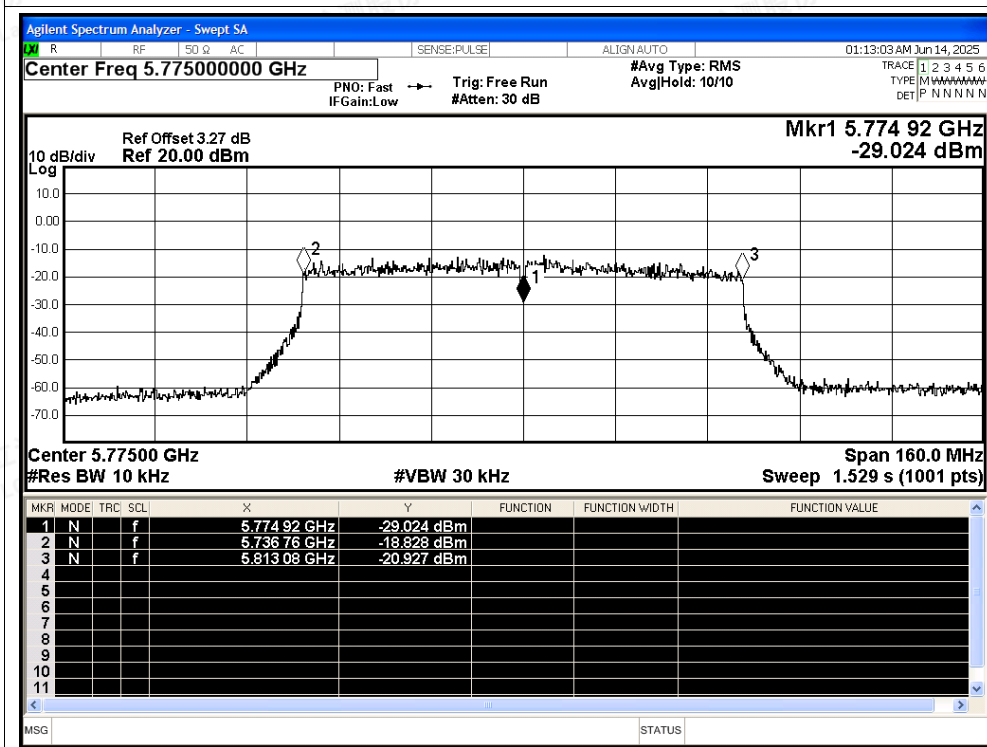

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



## G.6 Duty Cycle

| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant1    | 93.09          | 0.31                   | 0.73      |
| NVNT      | a    | 5785            | Ant1    | 93.03          | 0.31                   | 0.73      |
| NVNT      | a    | 5825            | Ant1    | 93.09          | 0.31                   | 0.73      |
| NVNT      | n20  | 5745            | Ant1    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n20  | 5785            | Ant1    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n20  | 5825            | Ant1    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n40  | 5755            | Ant1    | 84.89          | 0.71                   | 1.75      |
| NVNT      | n40  | 5795            | Ant1    | 84.89          | 0.71                   | 1.75      |
| NVNT      | ac20 | 5745            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5785            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5825            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac40 | 5755            | Ant1    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac40 | 5795            | Ant1    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac80 | 5775            | Ant1    | 73.91          | 1.31                   | 3.46      |
| NVNT      | ax20 | 5745            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ax20 | 5785            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ax20 | 5825            | Ant1    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ax40 | 5755            | Ant1    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ax40 | 5795            | Ant1    | 85.13          | 0.7                    | 1.73      |
| NVNT      | ax80 | 5775            | Ant1    | 73.91          | 1.31                   | 3.46      |



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant1

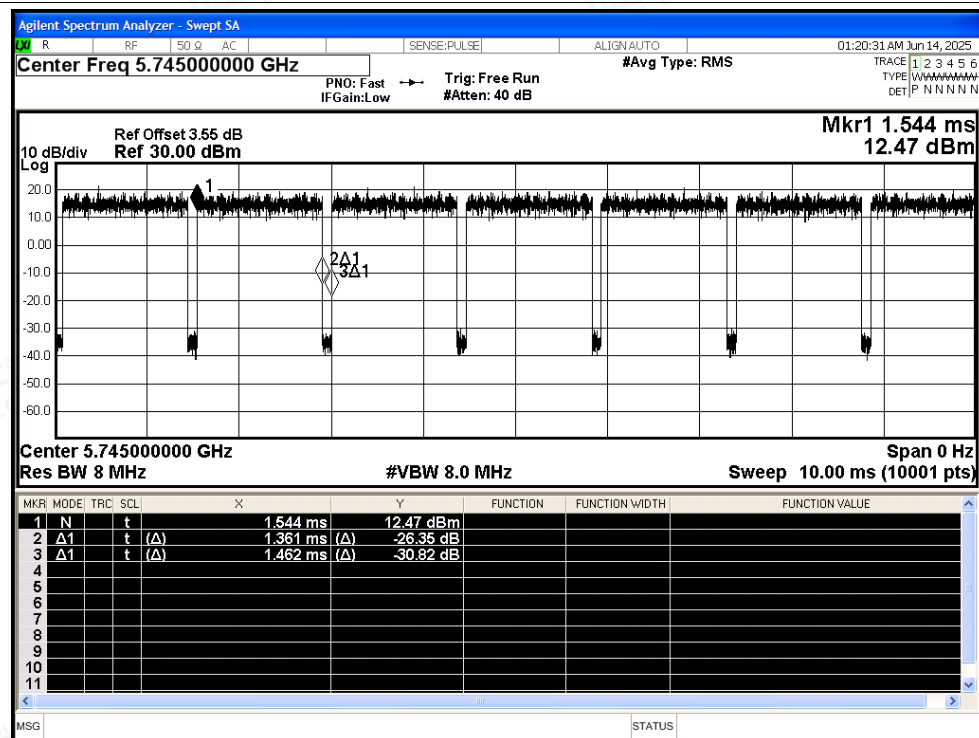

## Duty Cycle NVNT a 5785MHz Ant1

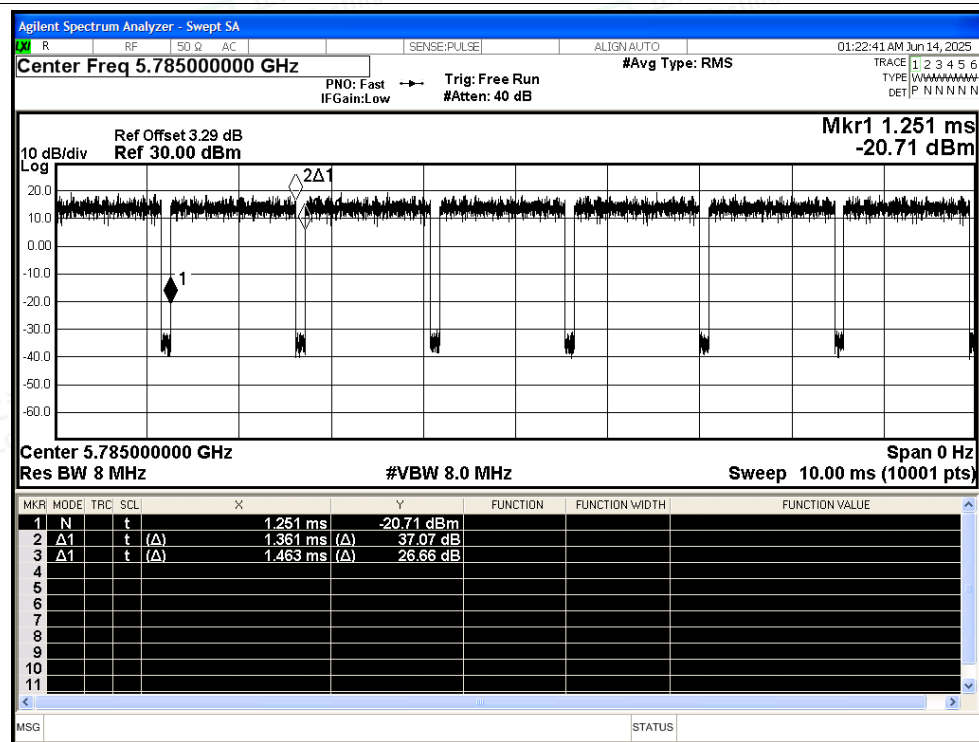

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT a 5825MHz Ant1

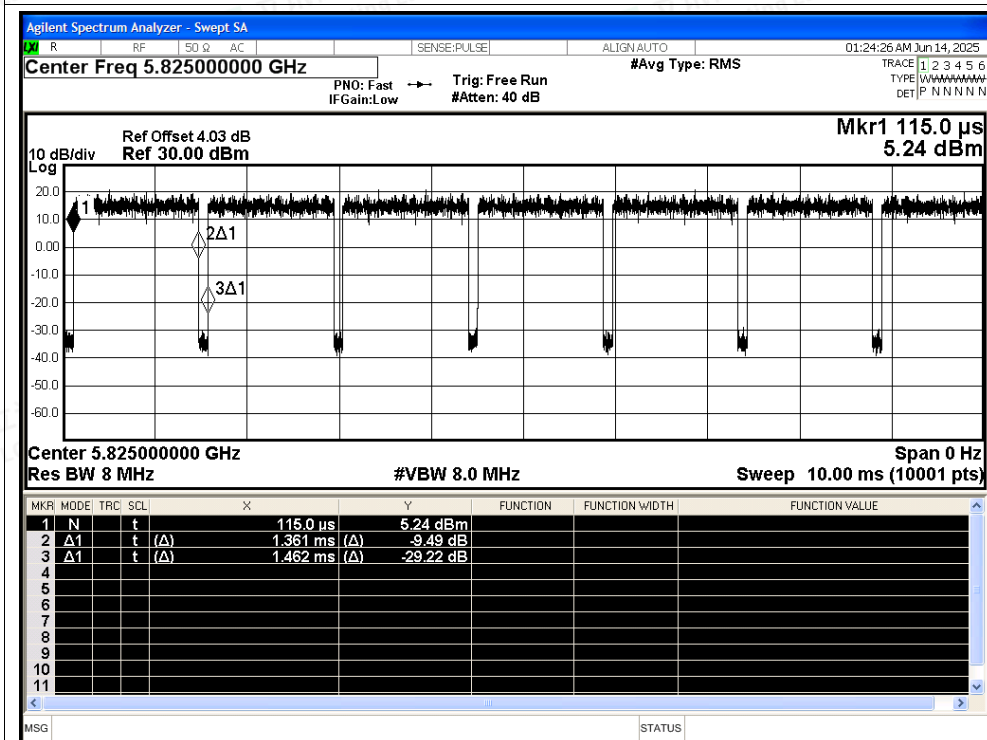

## Duty Cycle NVNT n20 5745MHz Ant1

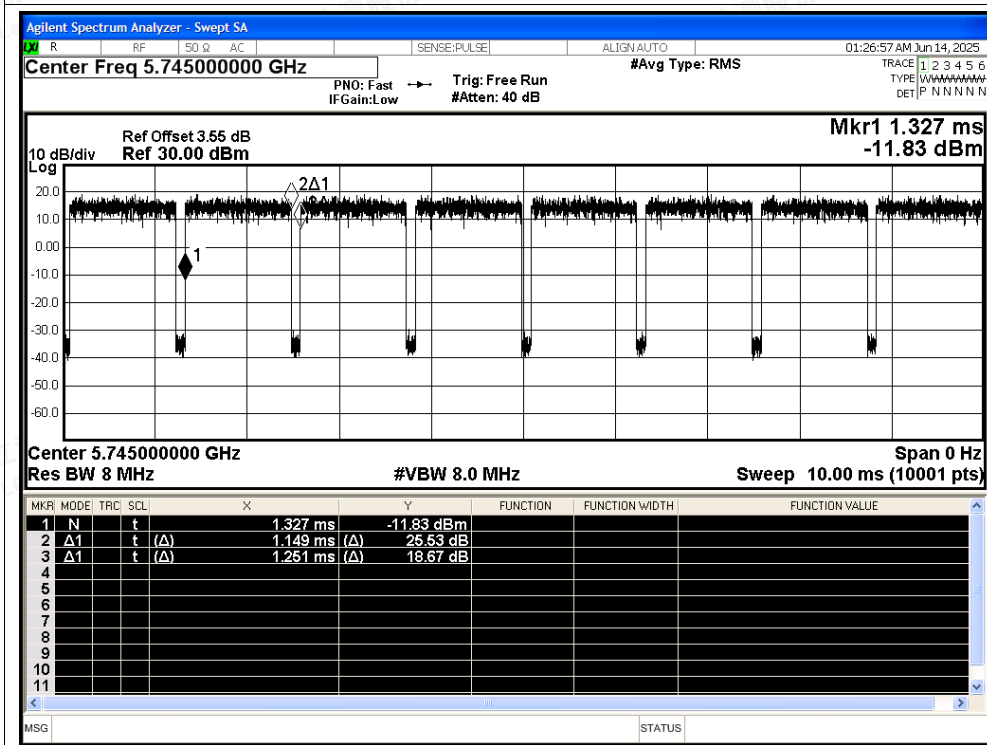

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5785MHz Ant1

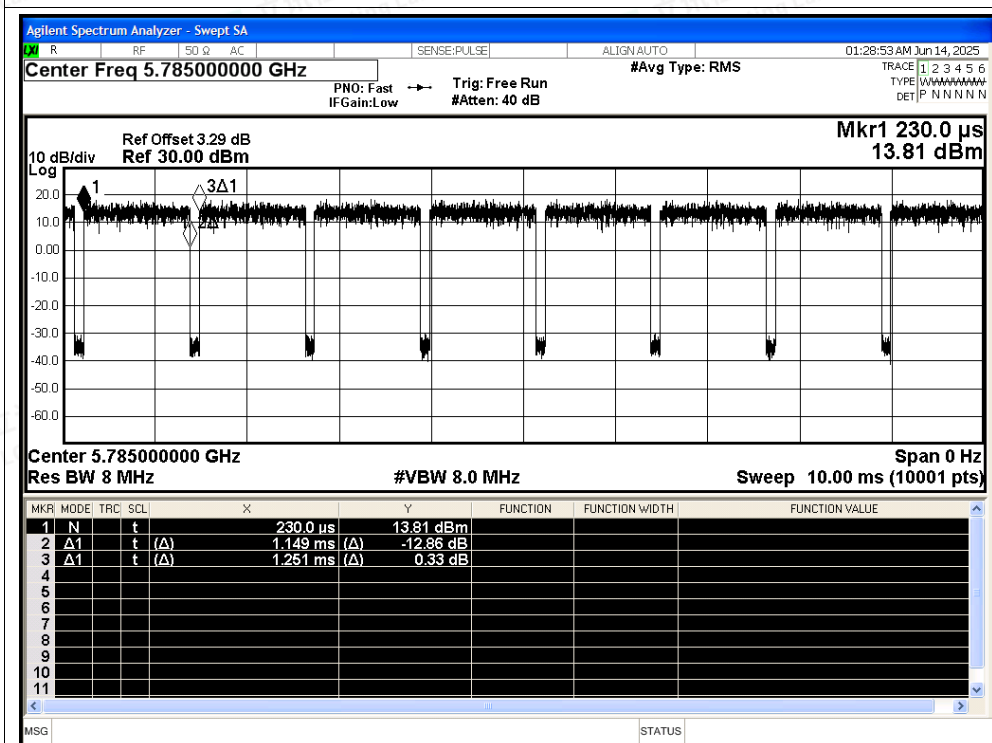

## Duty Cycle NVNT n20 5825MHz Ant1

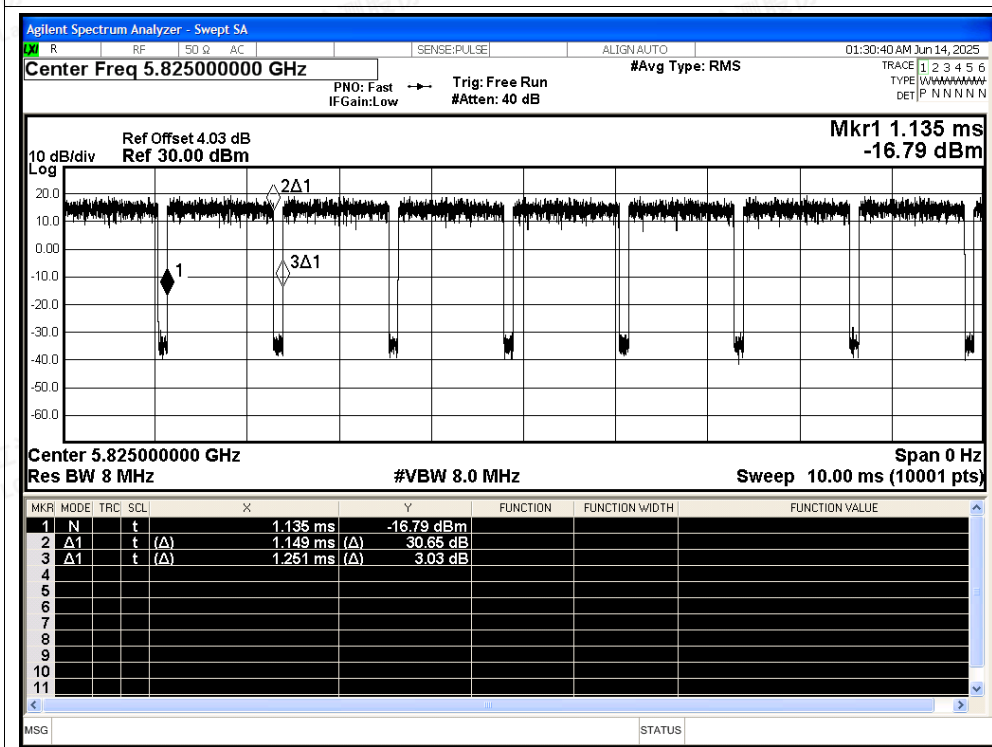

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5755MHz Ant1

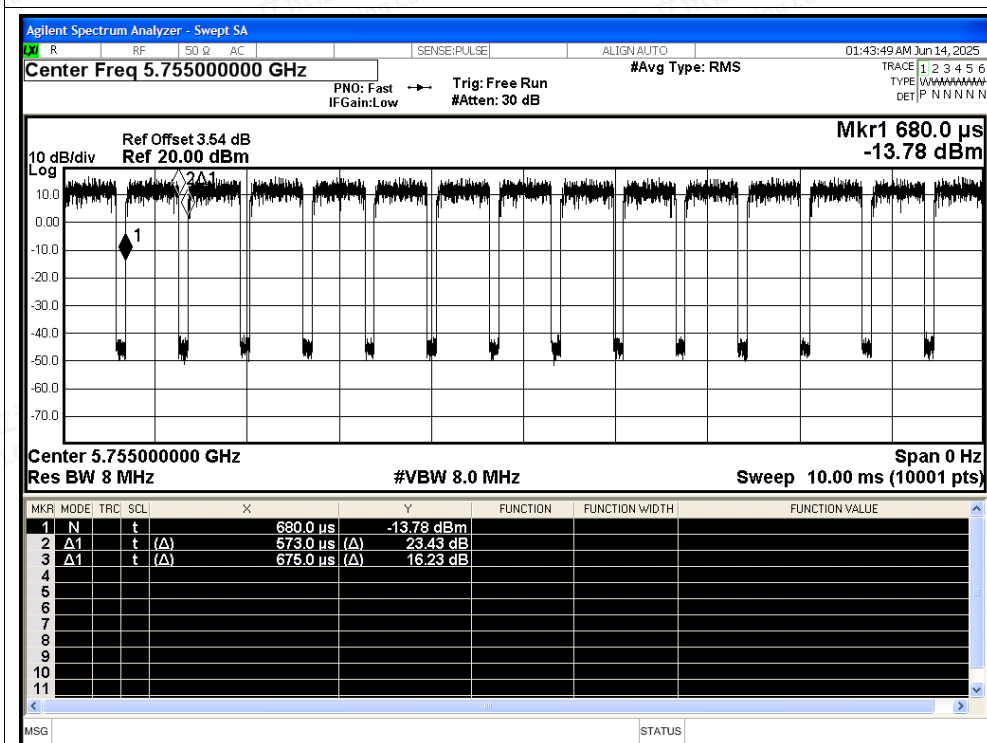

## Duty Cycle NVNT n40 5795MHz Ant1

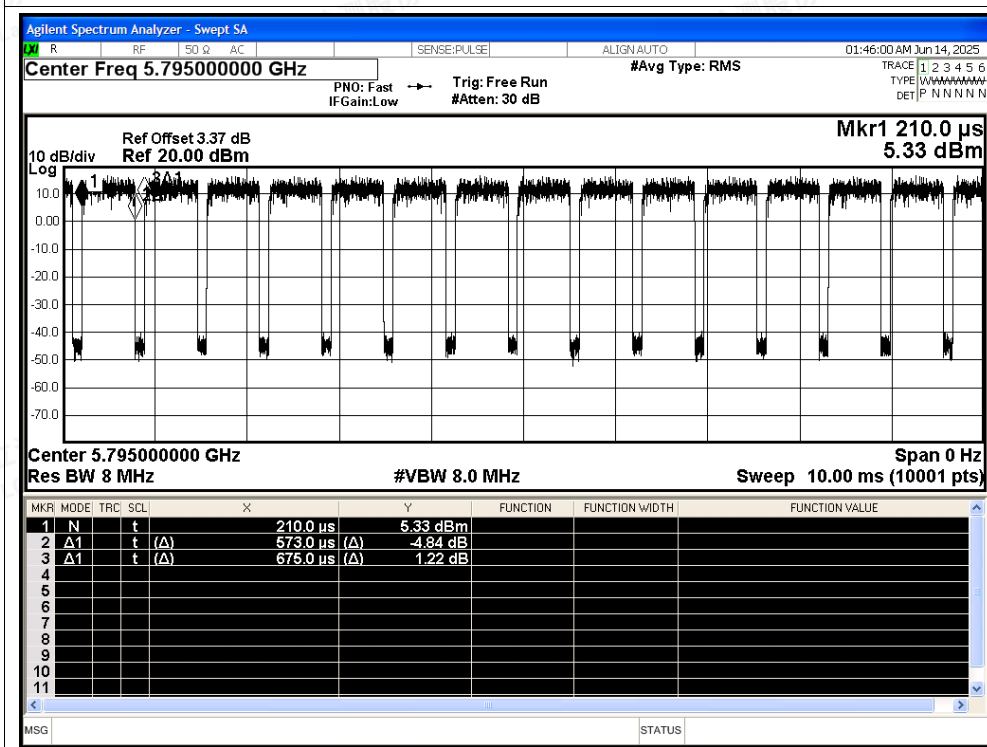

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5745MHz Ant1

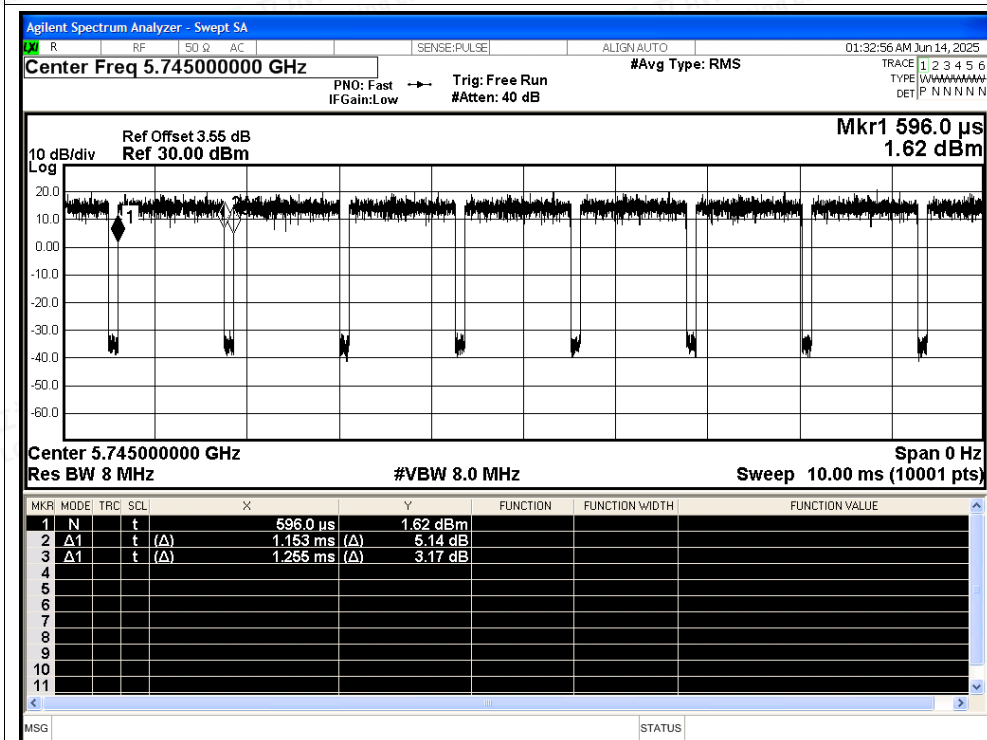

## Duty Cycle NVNT ac20 5785MHz Ant1

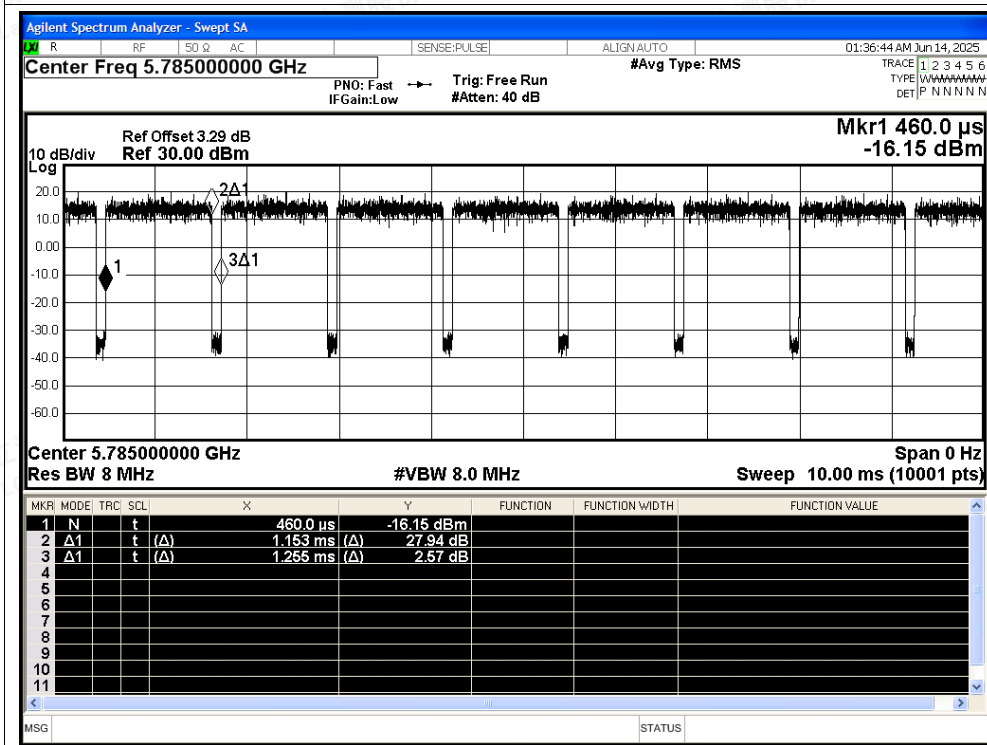

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Duty Cycle NVNT ac20 5825MHz Ant1

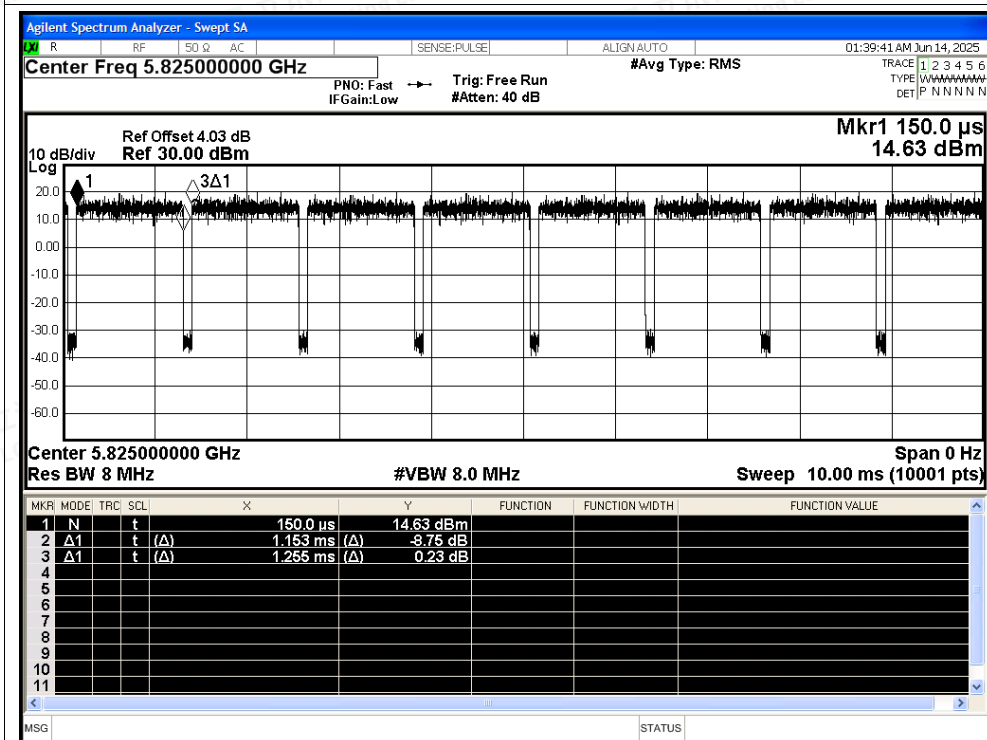

## Duty Cycle NVNT ac40 5755MHz Ant1

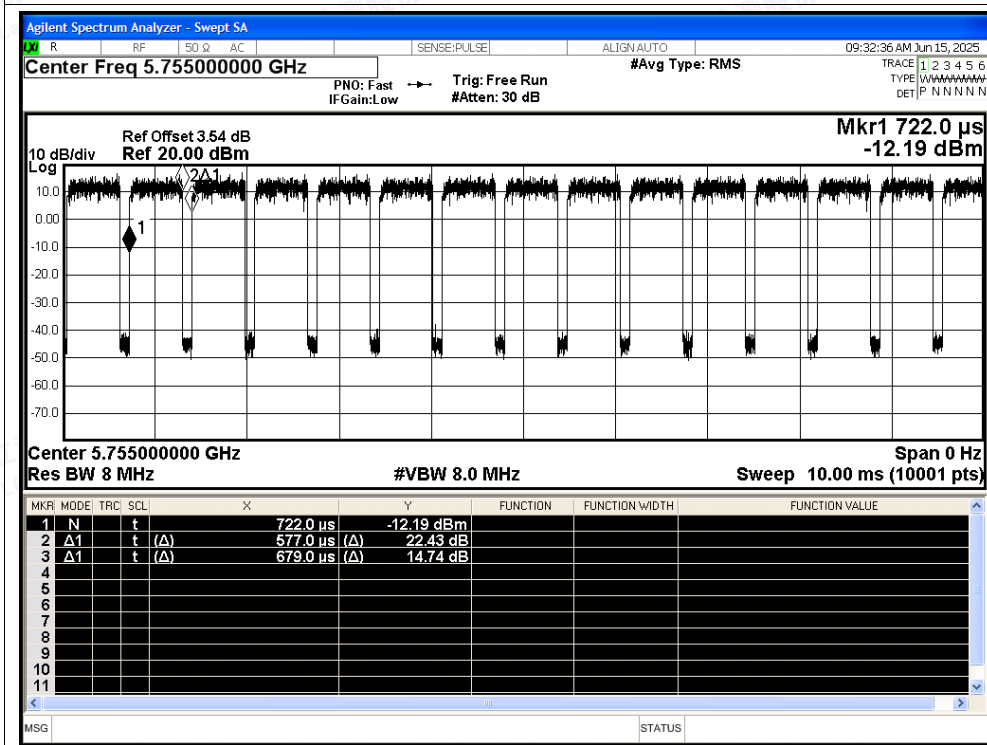

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5795MHz Ant1

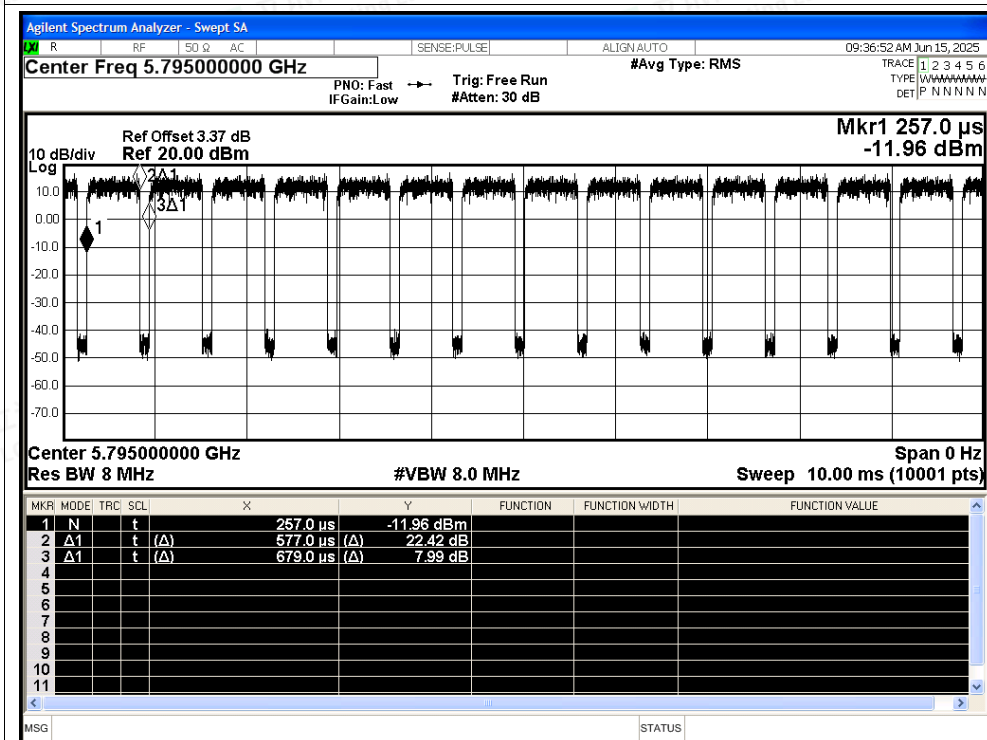

## Duty Cycle NVNT ac80 5775MHz Ant1

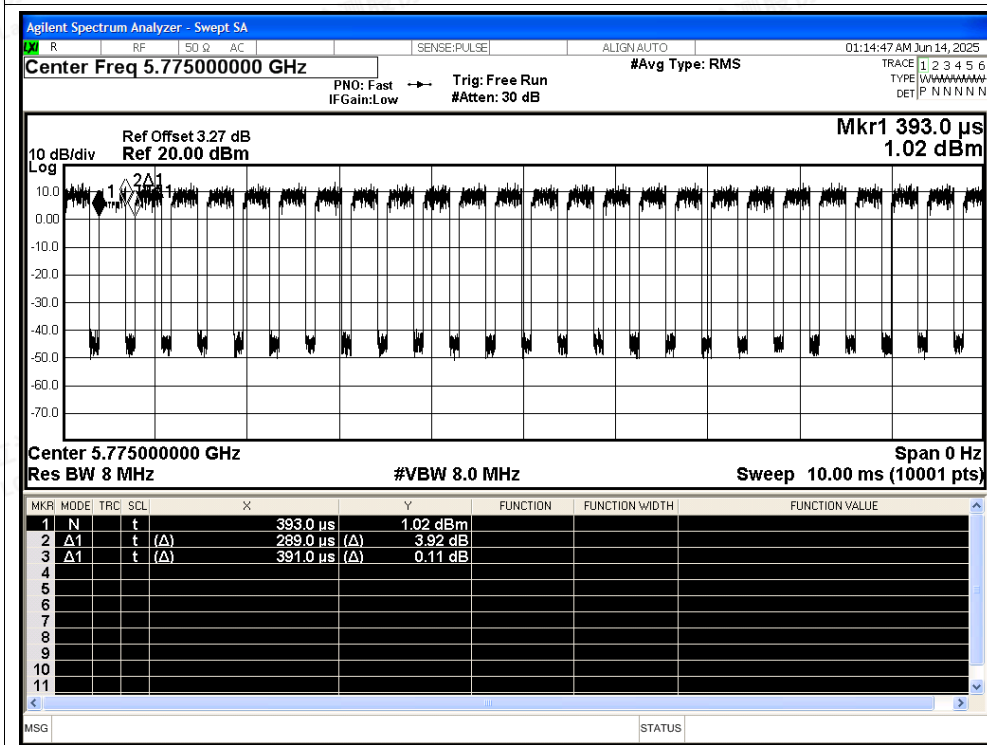

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5745MHz Ant1

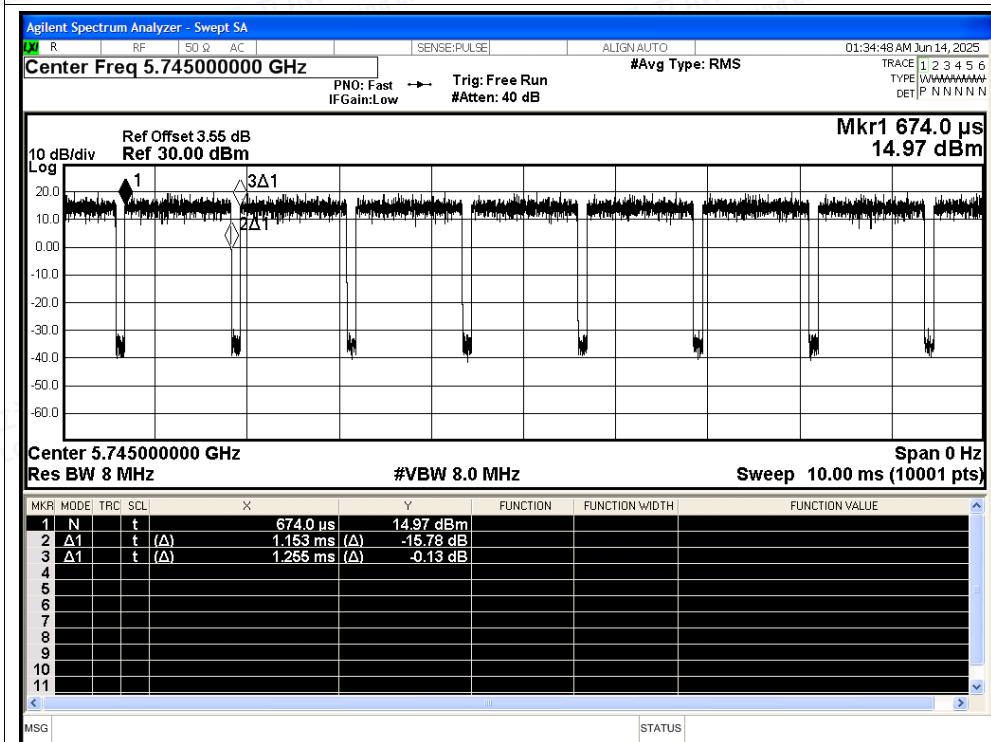

## Duty Cycle NVNT ax20 5785MHz Ant1

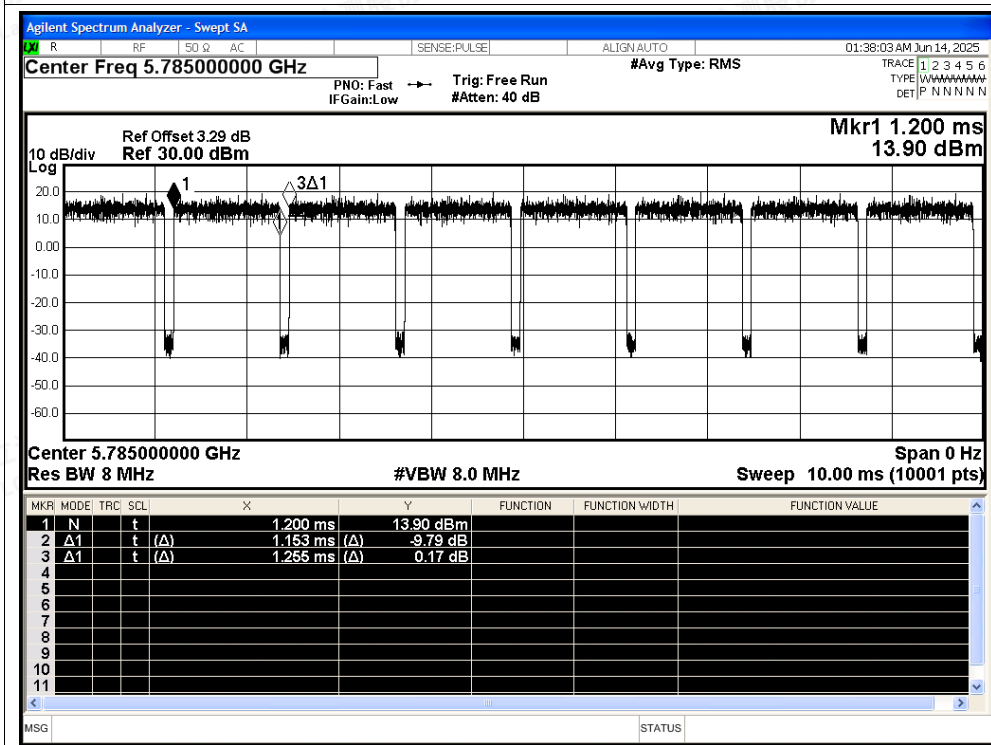

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5825MHz Ant1

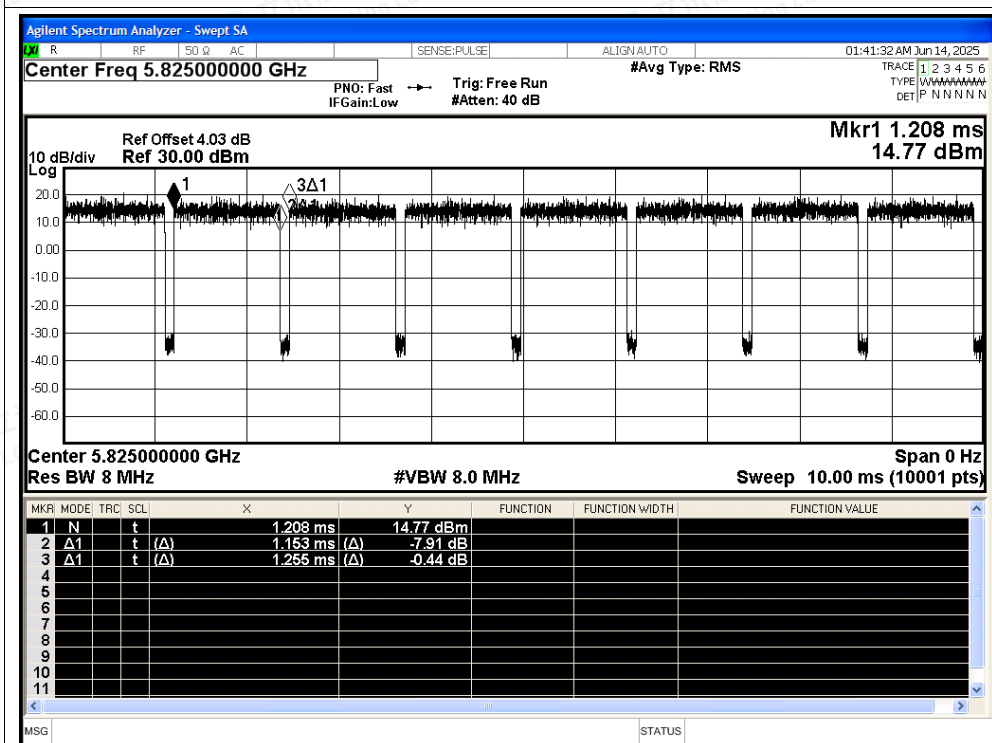

## Duty Cycle NVNT ax40 5755MHz Ant1

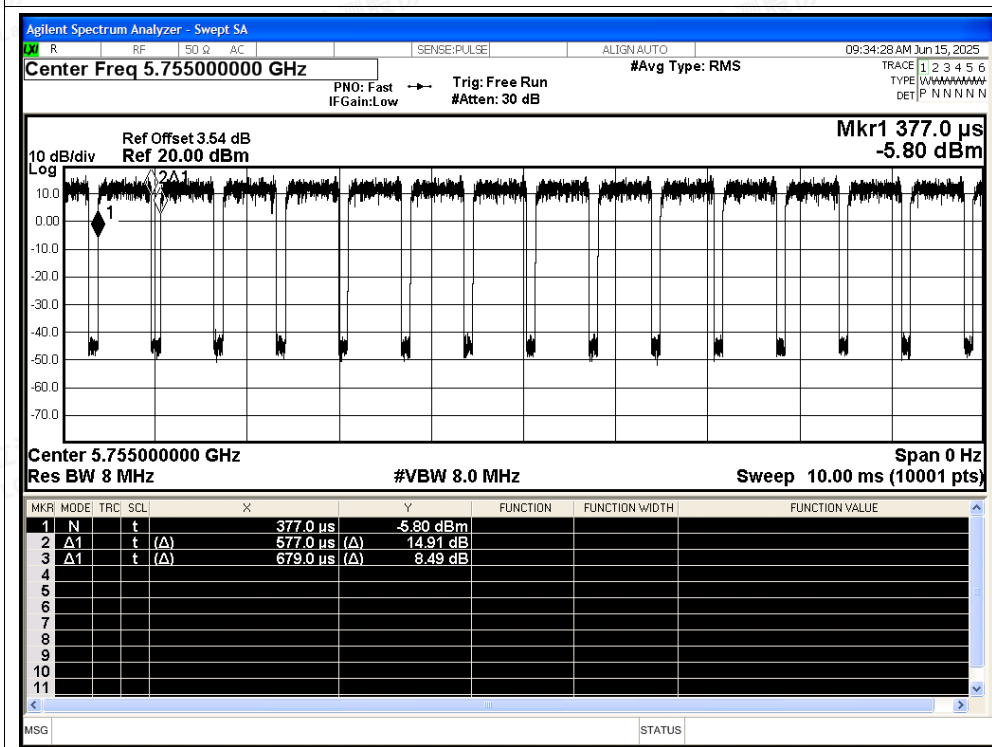

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5795MHz Ant1

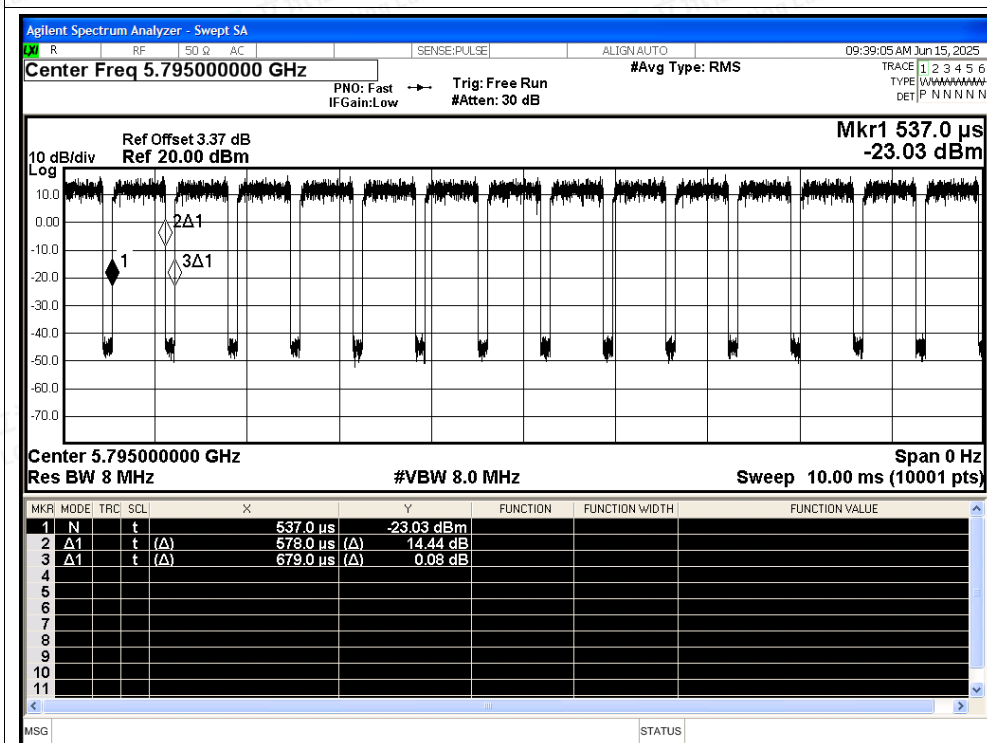

## Duty Cycle NVNT ax80 5775MHz Ant1

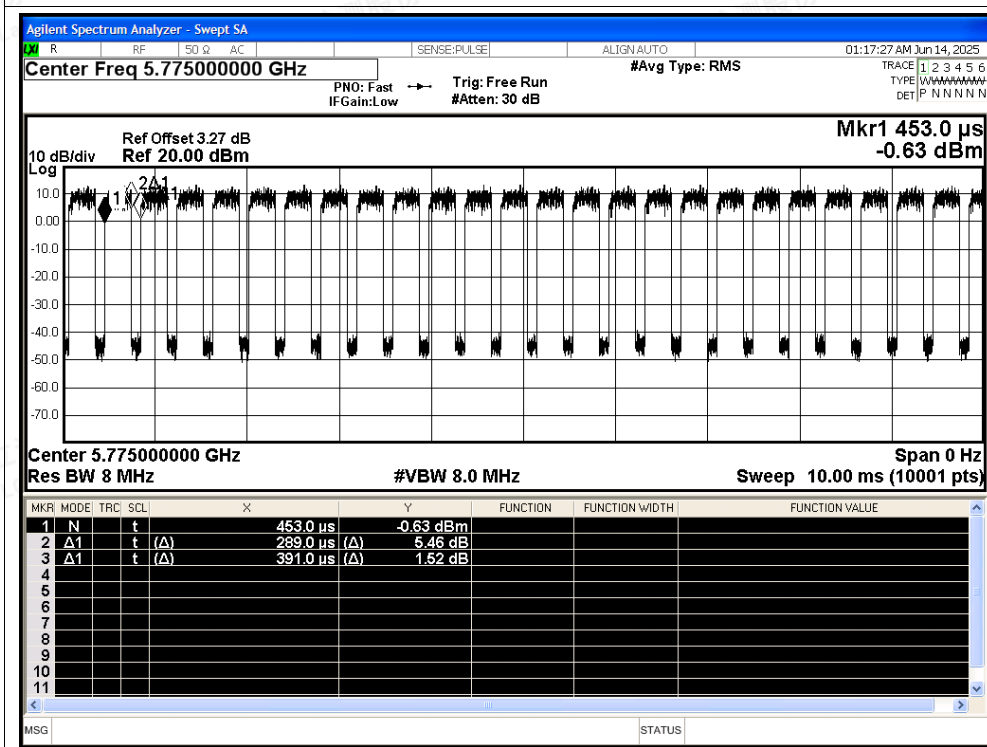

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




| Condition | Mode | Frequency (MHz) | Antenna | Duty Cycle (%) | Correction Factor (dB) | 1/T (kHz) |
|-----------|------|-----------------|---------|----------------|------------------------|-----------|
| NVNT      | a    | 5745            | Ant2    | 93.09          | 0.31                   | 0.73      |
| NVNT      | a    | 5785            | Ant2    | 93.03          | 0.31                   | 0.73      |
| NVNT      | a    | 5825            | Ant2    | 93.09          | 0.31                   | 0.73      |
| NVNT      | n20  | 5745            | Ant2    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n20  | 5785            | Ant2    | 91.85          | 0.37                   | 0.87      |
| NVNT      | n20  | 5825            | Ant2    | 91.92          | 0.37                   | 0.87      |
| NVNT      | n40  | 5755            | Ant2    | 84.89          | 0.71                   | 1.75      |
| NVNT      | n40  | 5795            | Ant2    | 84.89          | 0.71                   | 1.75      |
| NVNT      | ac20 | 5745            | Ant2    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5785            | Ant2    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac20 | 5825            | Ant2    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ac40 | 5755            | Ant2    | 85.1           | 0.7                    | 1.73      |
| NVNT      | ac40 | 5795            | Ant2    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ac80 | 5775            | Ant2    | 74.17          | 1.3                    | 3.45      |
| NVNT      | ax20 | 5745            | Ant2    | 90.72          | 0.42                   | 1.01      |
| NVNT      | ax20 | 5785            | Ant2    | 90.63          | 0.43                   | 1.01      |
| NVNT      | ax20 | 5825            | Ant2    | 91.87          | 0.37                   | 0.87      |
| NVNT      | ax40 | 5755            | Ant2    | 84.98          | 0.71                   | 1.73      |
| NVNT      | ax40 | 5795            | Ant2    | 85.1           | 0.7                    | 1.73      |
| NVNT      | ax80 | 5775            | Ant2    | 73.91          | 1.31                   | 3.46      |






## Test Graphs

## Duty Cycle NVNT a 5745MHz Ant2

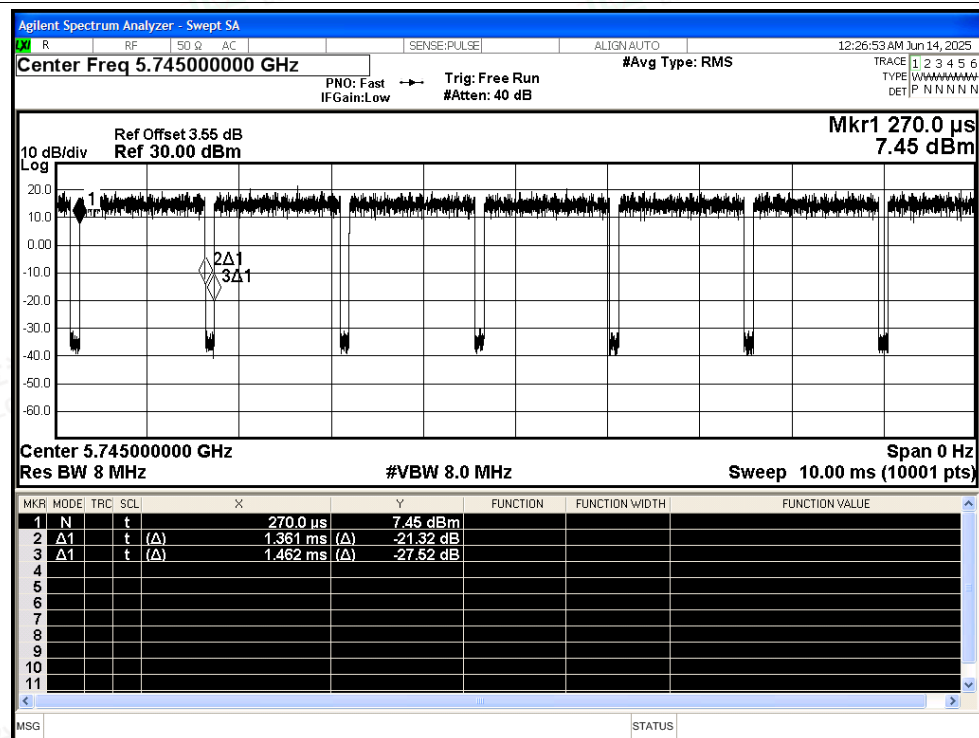

## Duty Cycle NVNT a 5785MHz Ant2

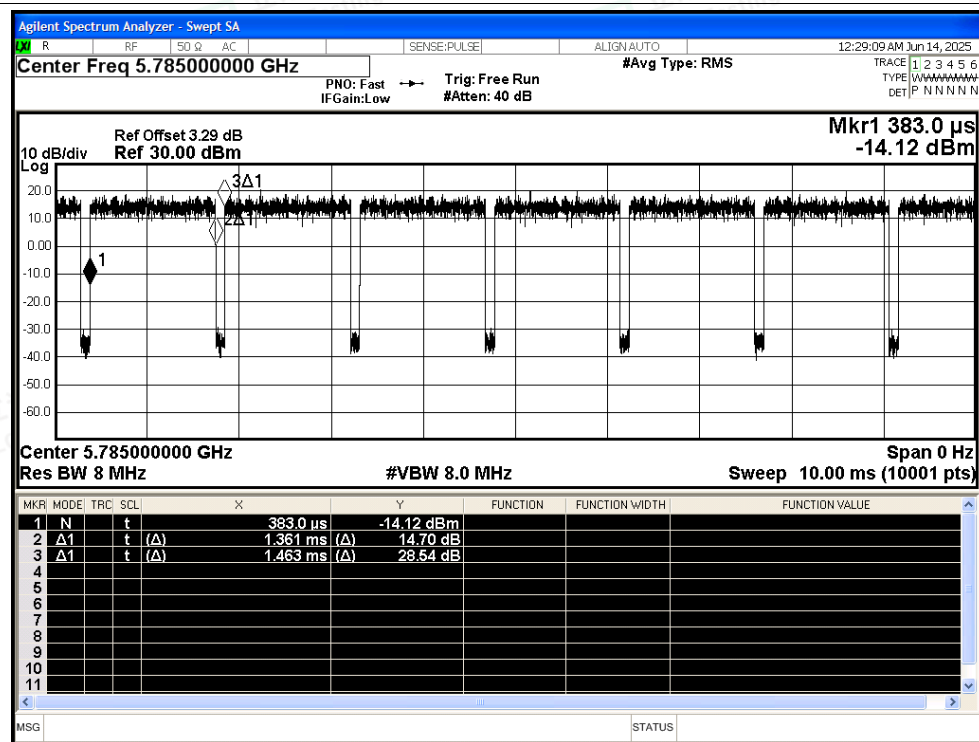

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Duty Cycle NVNT a 5825MHz Ant2

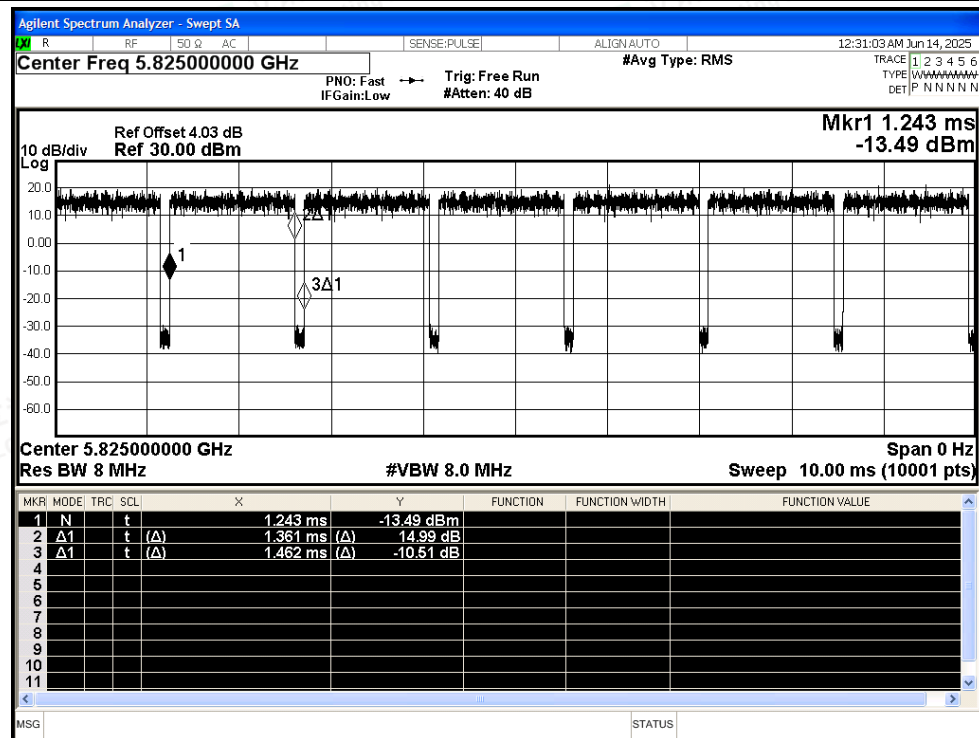

## Duty Cycle NVNT n20 5745MHz Ant2

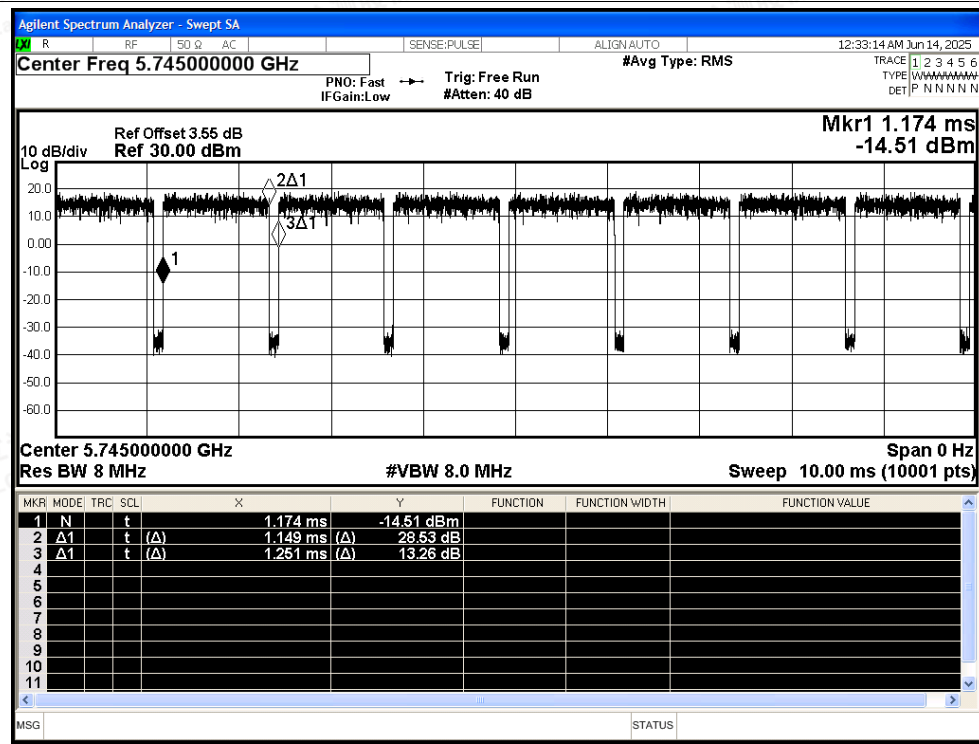

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n20 5785MHz Ant2

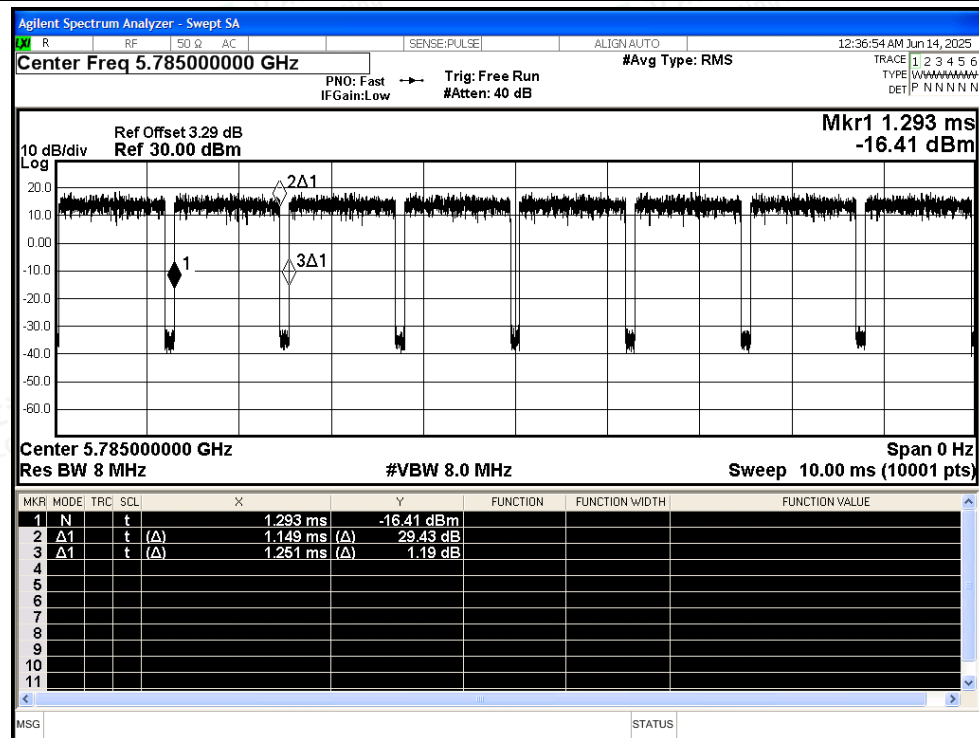

## Duty Cycle NVNT n20 5825MHz Ant2

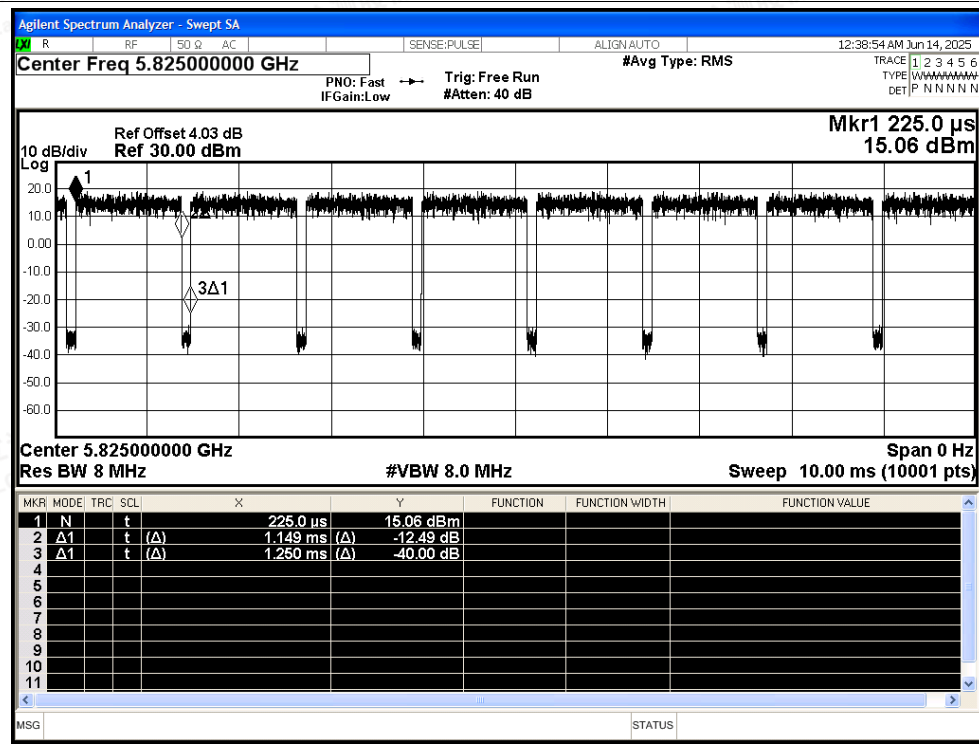

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT n40 5755MHz Ant2

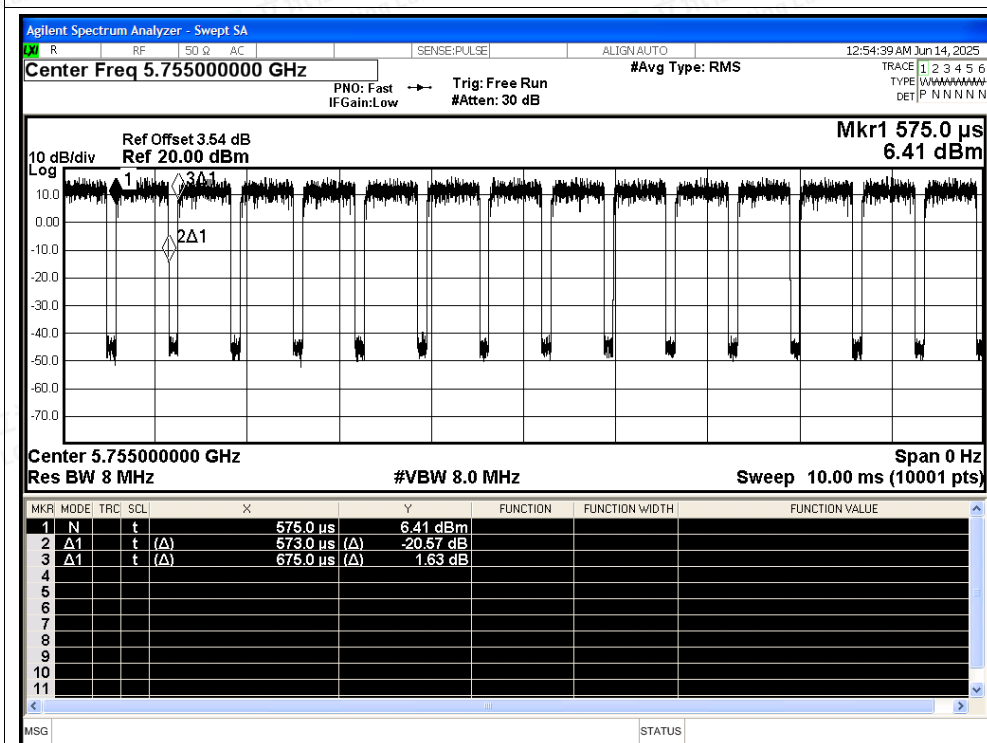

## Duty Cycle NVNT n40 5795MHz Ant2

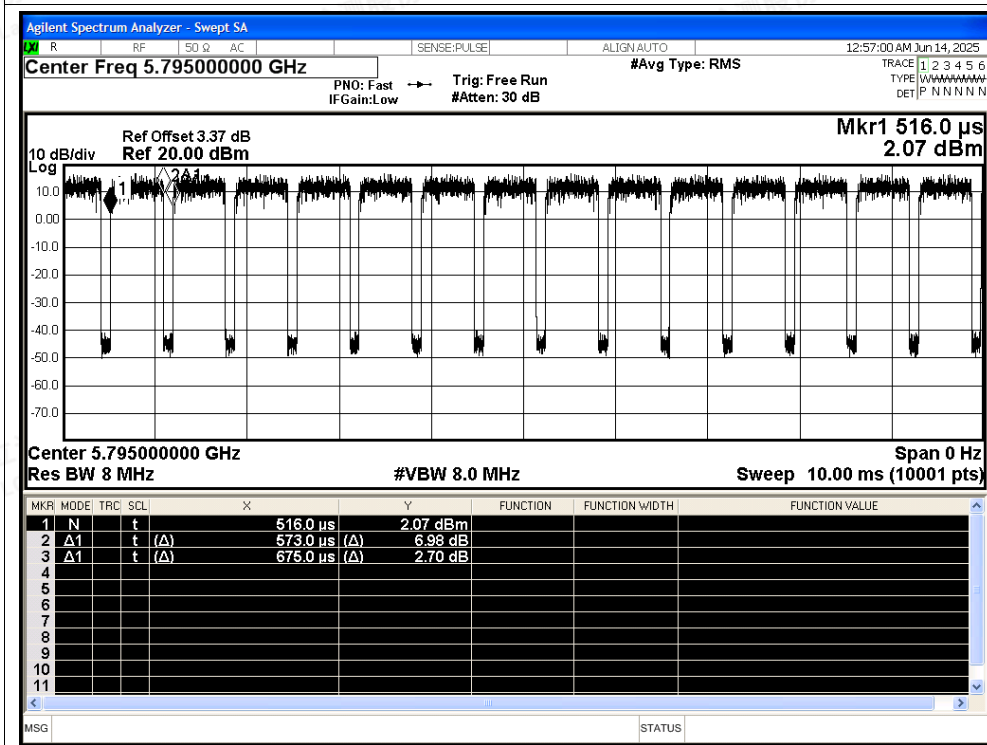

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5745MHz Ant2

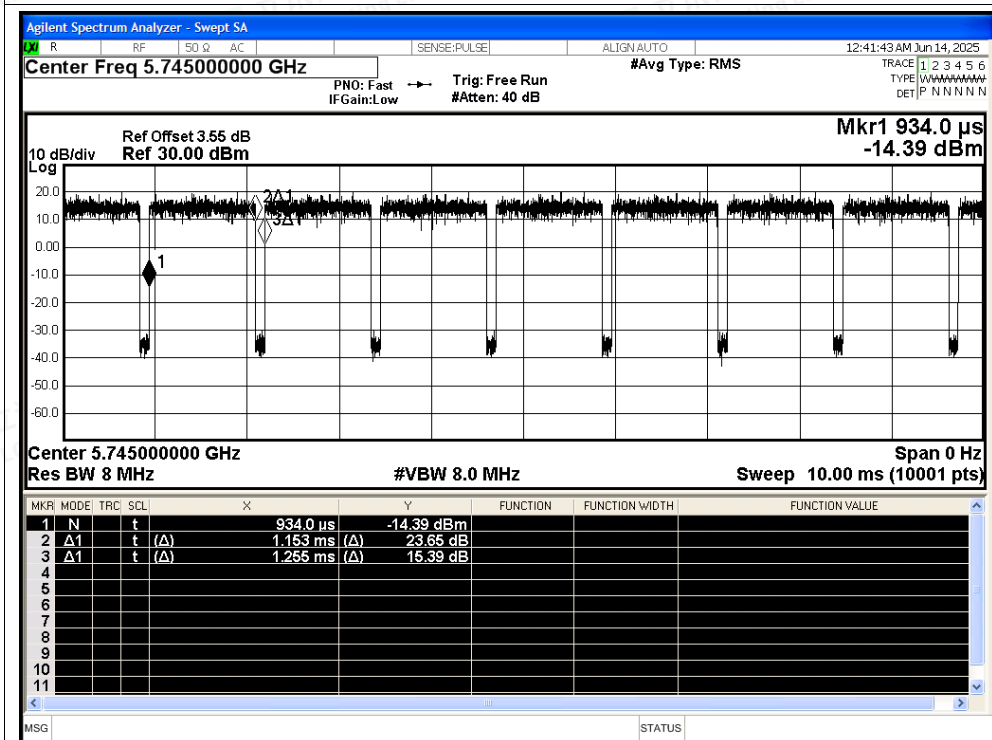

## Duty Cycle NVNT ac20 5785MHz Ant2

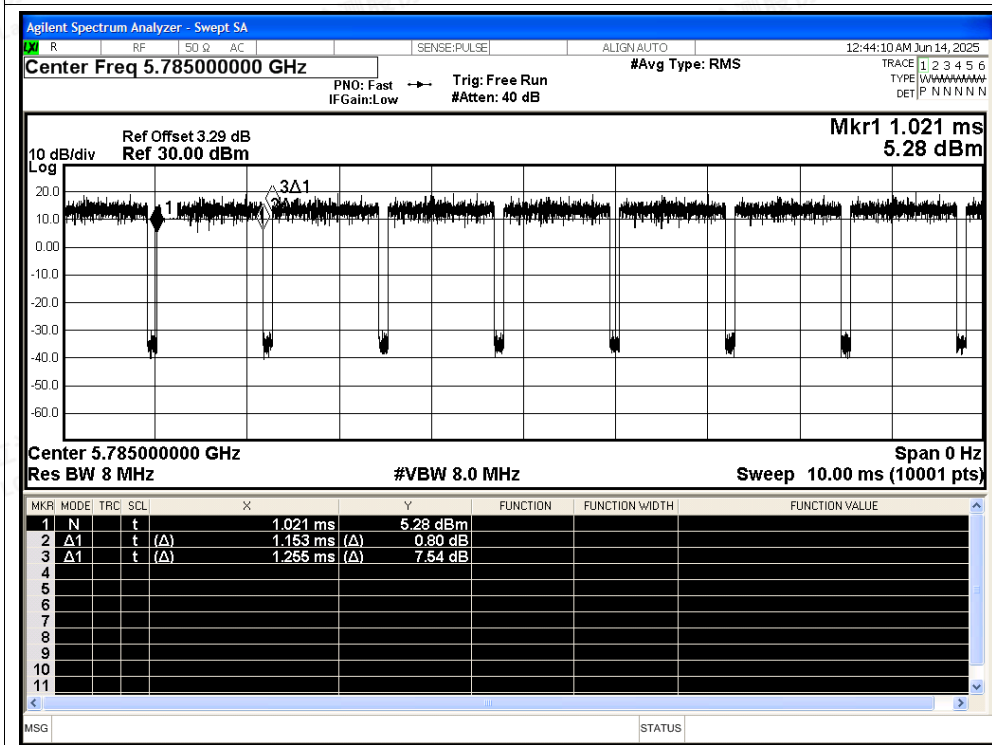

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac20 5825MHz Ant2

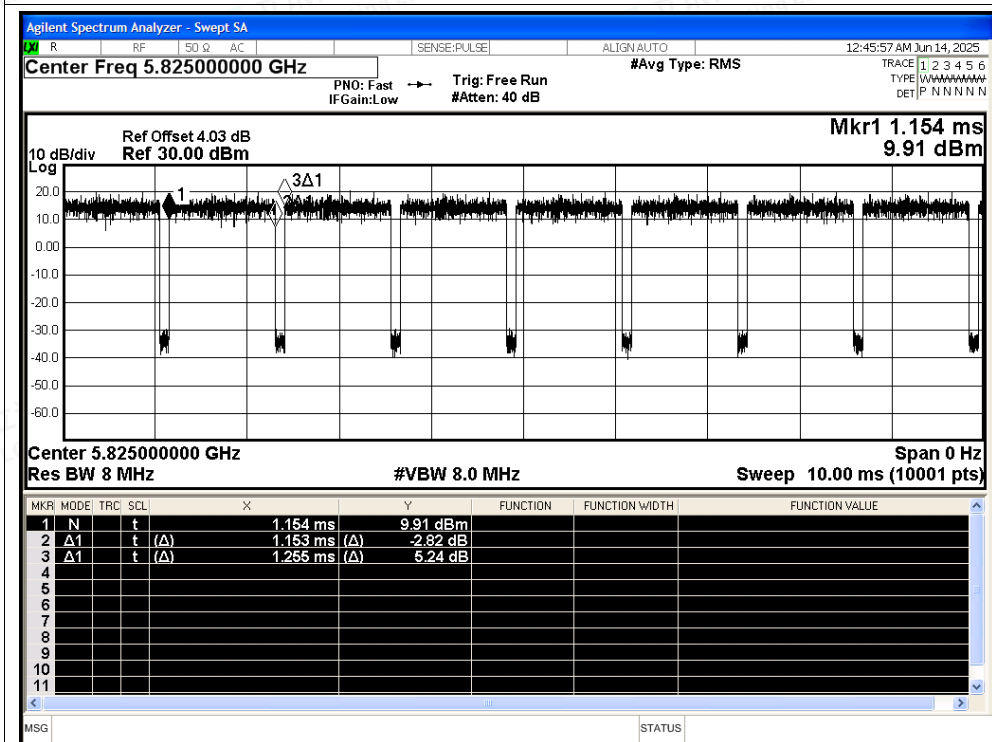

## Duty Cycle NVNT ac40 5755MHz Ant2

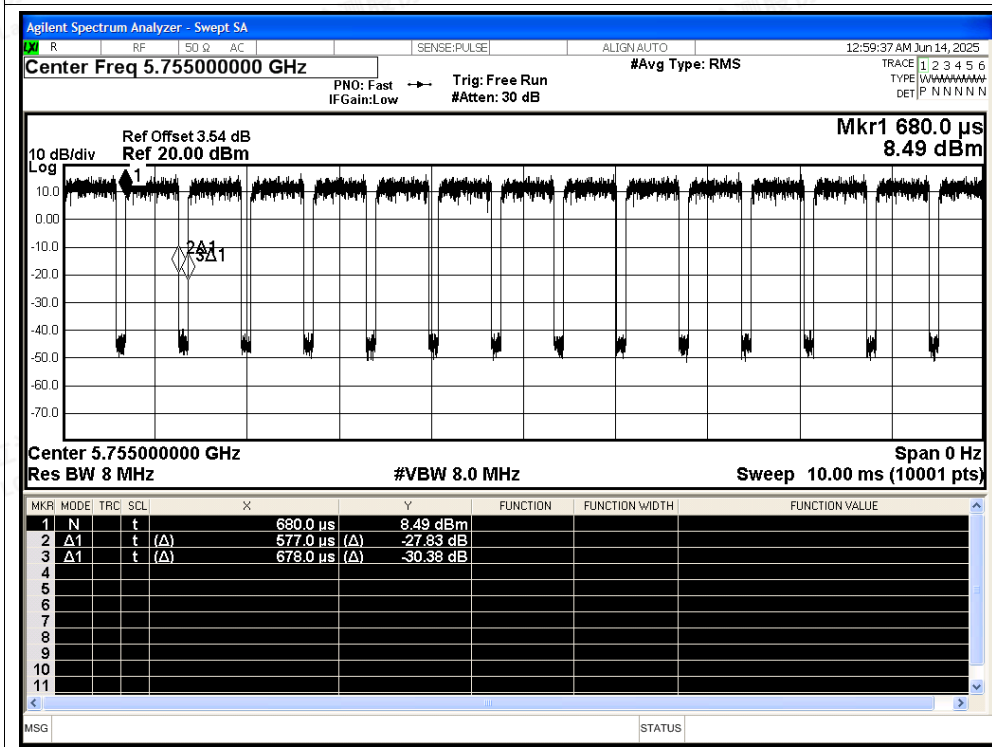

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ac40 5795MHz Ant2

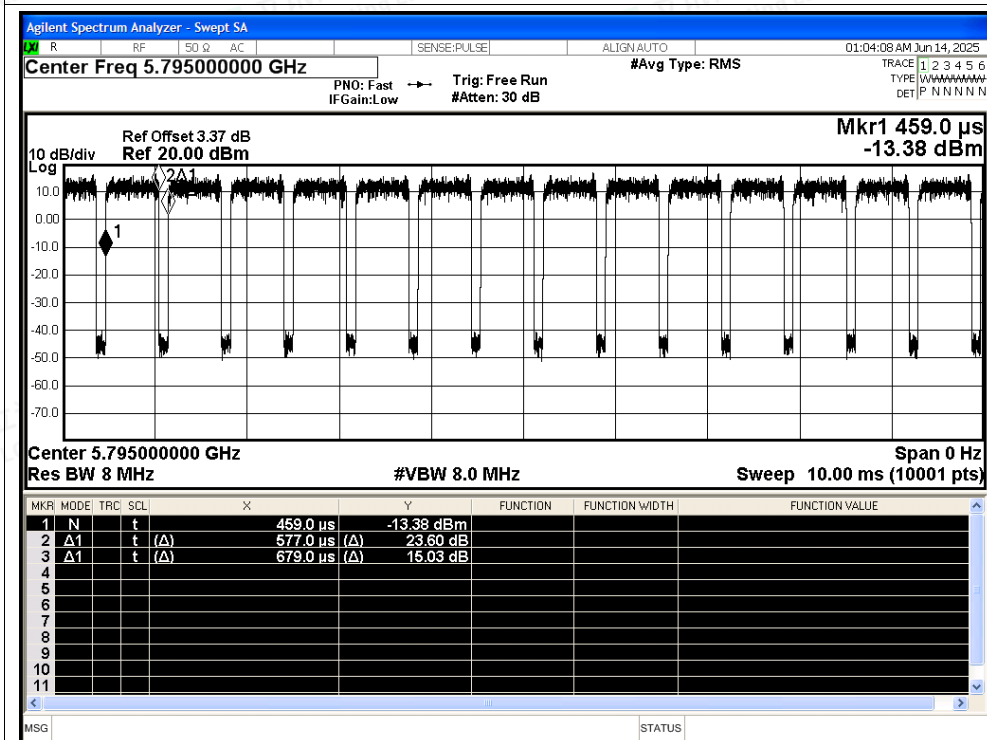

## Duty Cycle NVNT ac80 5775MHz Ant2

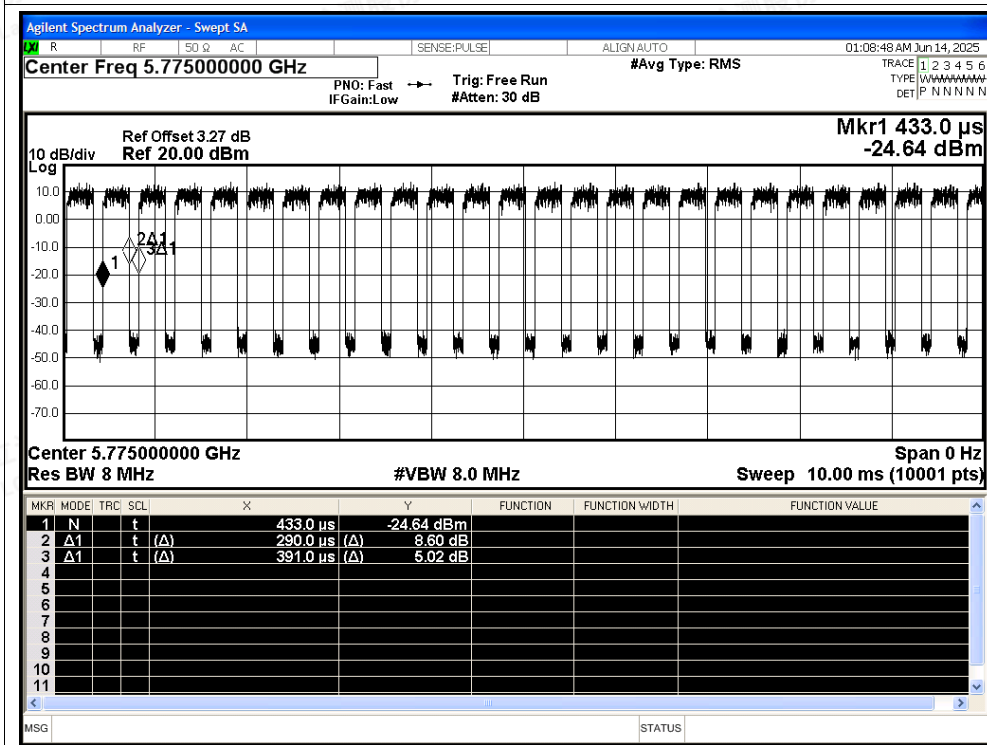

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax20 5745MHz Ant2

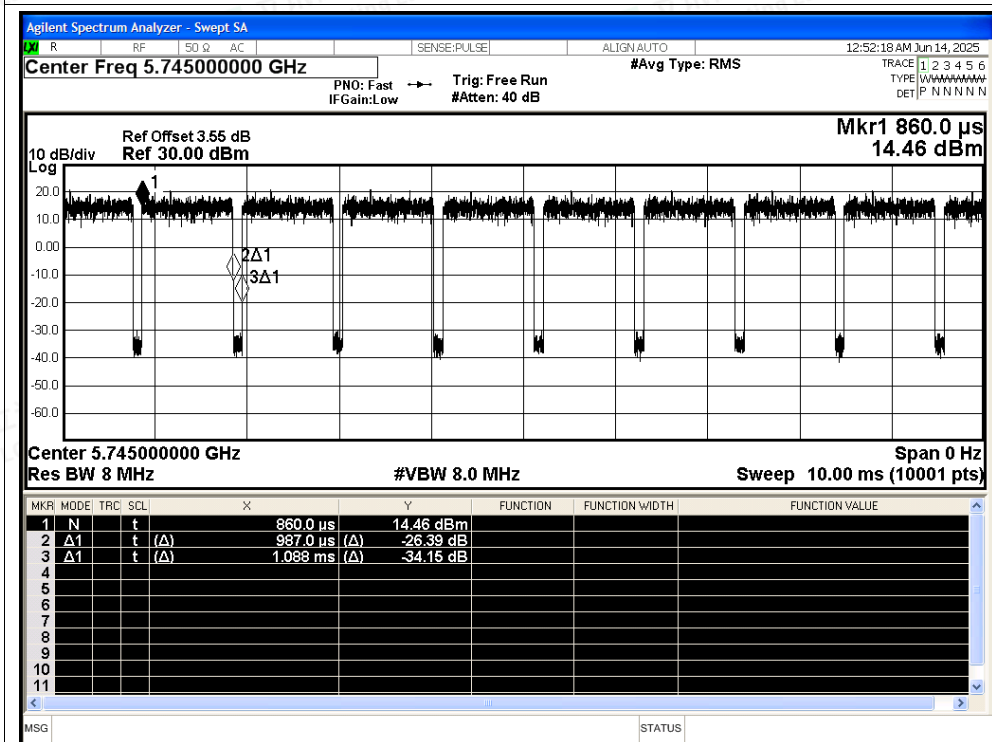

## Duty Cycle NVNT ax20 5785MHz Ant2

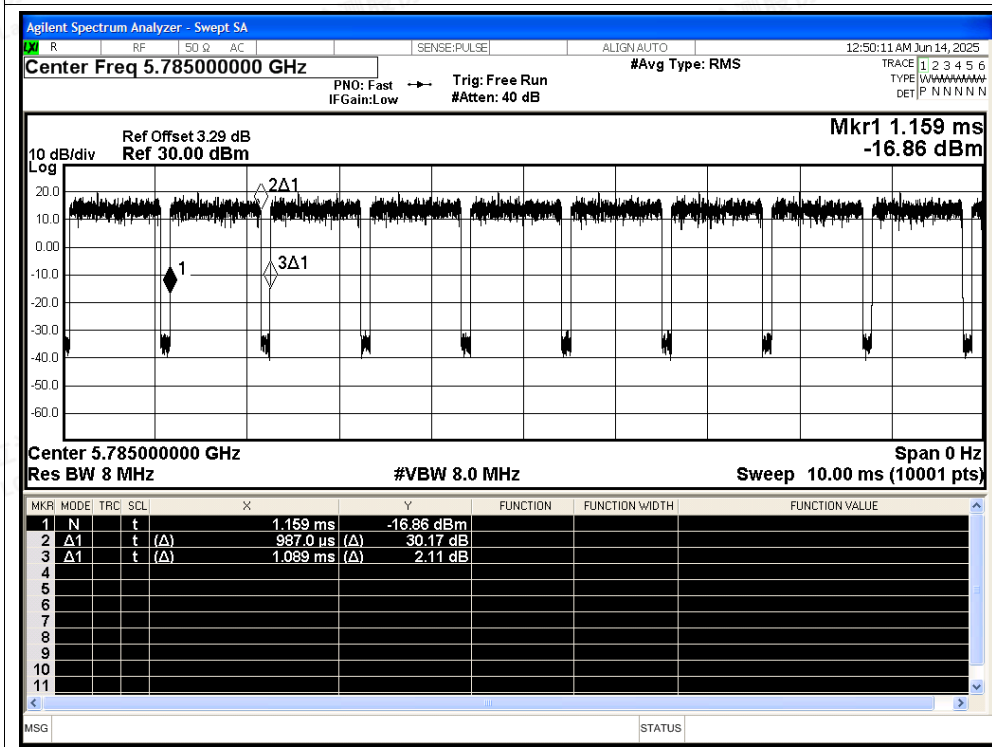

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity






## Duty Cycle NVNT ax20 5825MHz Ant2

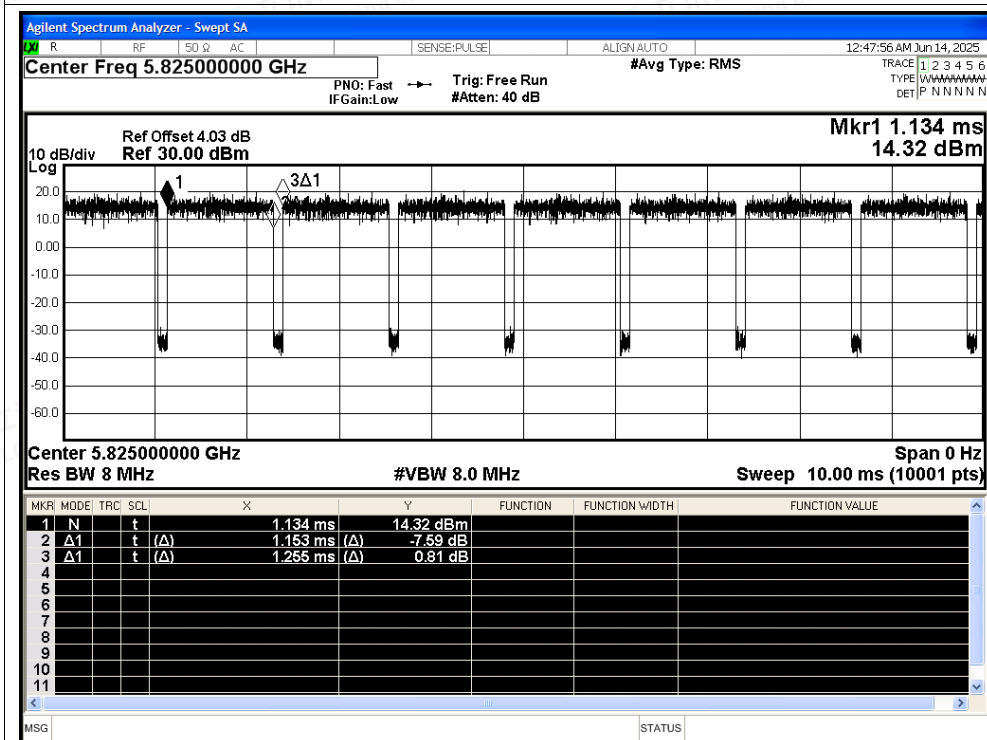

## Duty Cycle NVNT ax40 5755MHz Ant2

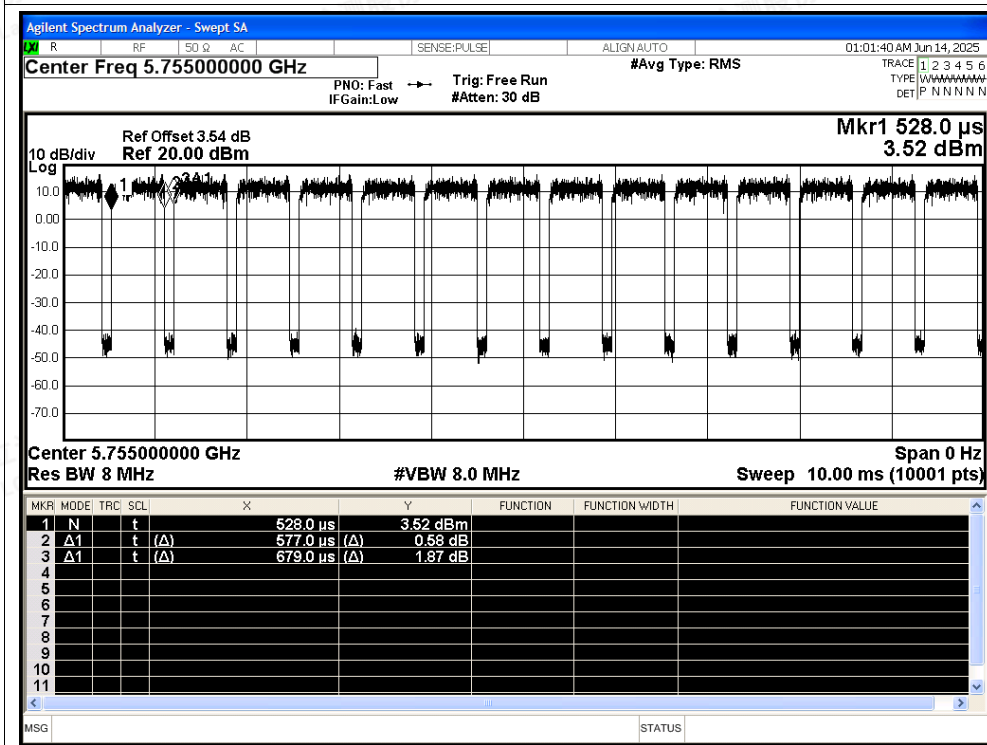

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



## Duty Cycle NVNT ax40 5795MHz Ant2

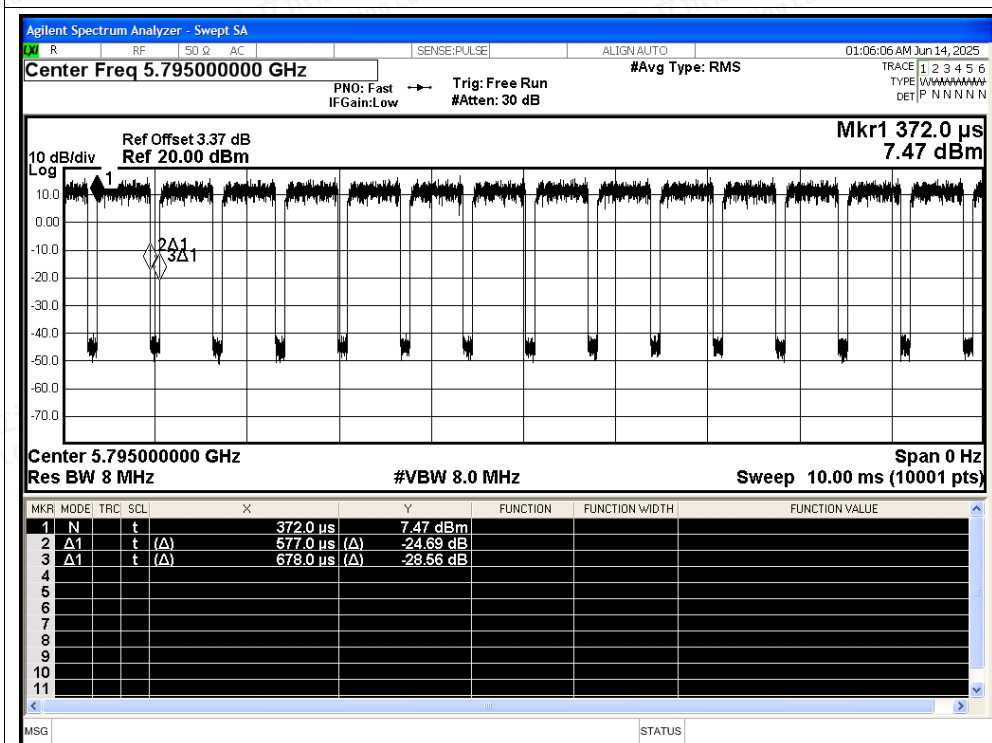

## Duty Cycle NVNT ax80 5775MHz Ant2

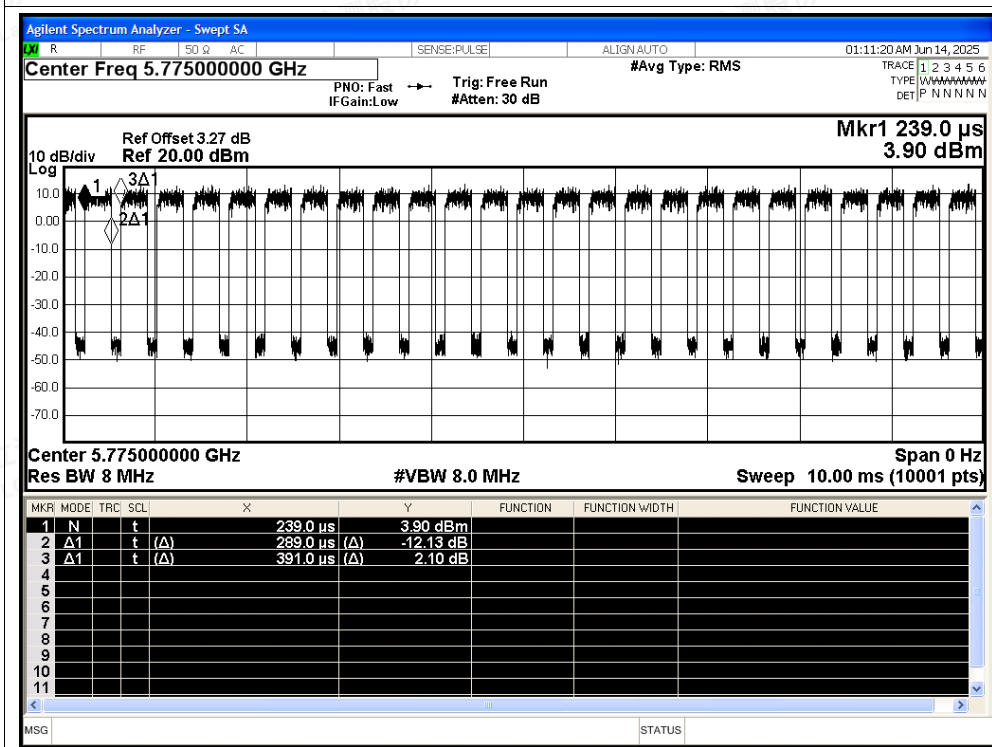

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A &amp; 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity