



Appendix P: Test Data for E-UTRA Band 41

Product Name: Tablet

Test Model: HIP-T66

Environmental Conditions

Temperature:	23.8°C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Jose Zhu
Supervised by:	Nick Peng





P.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	24.20	PASS
Band41	5MHz	16QAM	39675	1RB#0	24.07	PASS
Band41	5MHz	QPSK	39675	1RB#12	24.49	PASS
Band41	5MHz	16QAM	39675	1RB#12	24.08	PASS
Band41	5MHz	QPSK	39675	1RB#24	24.09	PASS
Band41	5MHz	16QAM	39675	1RB#24	24.02	PASS
Band41	5MHz	QPSK	39675	12RB#0	23.53	PASS
Band41	5MHz	16QAM	39675	12RB#0	22.50	PASS
Band41	5MHz	QPSK	39675	12RB#6	23.45	PASS
Band41	5MHz	16QAM	39675	12RB#6	22.35	PASS
Band41	5MHz	QPSK	39675	12RB#13	23.41	PASS
Band41	5MHz	16QAM	39675	12RB#13	22.52	PASS
Band41	5MHz	QPSK	39675	25RB#0	23.45	PASS
Band41	5MHz	16QAM	39675	25RB#0	22.55	PASS
Band41	5MHz	QPSK	40620	1RB#0	24.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	23.64	PASS
Band41	5MHz	QPSK	40620	1RB#12	24.26	PASS
Band41	5MHz	16QAM	40620	1RB#12	23.56	PASS
Band41	5MHz	QPSK	40620	1RB#24	24.28	PASS
Band41	5MHz	16QAM	40620	1RB#24	23.49	PASS
Band41	5MHz	QPSK	40620	12RB#0	23.31	PASS
Band41	5MHz	16QAM	40620	12RB#0	22.41	PASS
Band41	5MHz	QPSK	40620	12RB#6	23.33	PASS
Band41	5MHz	16QAM	40620	12RB#6	22.39	PASS
Band41	5MHz	QPSK	40620	12RB#13	23.29	PASS
Band41	5MHz	16QAM	40620	12RB#13	22.32	PASS
Band41	5MHz	QPSK	40620	25RB#0	23.34	PASS
Band41	5MHz	16QAM	40620	25RB#0	22.45	PASS
Band41	5MHz	QPSK	41565	1RB#0	24.04	PASS
Band41	5MHz	16QAM	41565	1RB#0	23.57	PASS
Band41	5MHz	QPSK	41565	1RB#12	24.27	PASS
Band41	5MHz	16QAM	41565	1RB#12	23.65	PASS
Band41	5MHz	QPSK	41565	1RB#24	24.08	PASS
Band41	5MHz	16QAM	41565	1RB#24	23.70	PASS
Band41	5MHz	QPSK	41565	12RB#0	23.15	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	22.30	PASS
Band41	5MHz	QPSK	41565	12RB#6	23.16	PASS
Band41	5MHz	16QAM	41565	12RB#6	22.30	PASS
Band41	5MHz	QPSK	41565	12RB#13	23.26	PASS
Band41	5MHz	16QAM	41565	12RB#13	22.37	PASS
Band41	5MHz	QPSK	41565	25RB#0	23.12	PASS
Band41	5MHz	16QAM	41565	25RB#0	22.38	PASS
Band41	10MHz	QPSK	39700	1RB#0	24.51	PASS
Band41	10MHz	16QAM	39700	1RB#0	23.70	PASS
Band41	10MHz	QPSK	39700	1RB#24	24.59	PASS
Band41	10MHz	16QAM	39700	1RB#24	23.60	PASS
Band41	10MHz	QPSK	39700	1RB#49	24.50	PASS
Band41	10MHz	16QAM	39700	1RB#49	23.59	PASS
Band41	10MHz	QPSK	39700	25RB#0	23.46	PASS
Band41	10MHz	16QAM	39700	25RB#0	22.69	PASS
Band41	10MHz	QPSK	39700	25RB#12	23.47	PASS
Band41	10MHz	16QAM	39700	25RB#12	22.70	PASS
Band41	10MHz	QPSK	39700	25RB#25	23.51	PASS
Band41	10MHz	16QAM	39700	25RB#25	22.73	PASS
Band41	10MHz	QPSK	39700	50RB#0	23.42	PASS
Band41	10MHz	16QAM	39700	50RB#0	22.60	PASS
Band41	10MHz	QPSK	40620	1RB#0	24.37	PASS
Band41	10MHz	16QAM	40620	1RB#0	23.82	PASS
Band41	10MHz	QPSK	40620	1RB#24	24.38	PASS
Band41	10MHz	16QAM	40620	1RB#24	23.78	PASS
Band41	10MHz	QPSK	40620	1RB#49	24.22	PASS
Band41	10MHz	16QAM	40620	1RB#49	23.83	PASS
Band41	10MHz	QPSK	40620	25RB#0	23.09	PASS
Band41	10MHz	16QAM	40620	25RB#0	22.30	PASS
Band41	10MHz	QPSK	40620	25RB#12	23.11	PASS
Band41	10MHz	16QAM	40620	25RB#12	22.31	PASS
Band41	10MHz	QPSK	40620	25RB#25	23.08	PASS
Band41	10MHz	16QAM	40620	25RB#25	22.31	PASS
Band41	10MHz	QPSK	40620	50RB#0	23.19	PASS
Band41	10MHz	16QAM	40620	50RB#0	22.34	PASS
Band41	10MHz	QPSK	41540	1RB#0	24.14	PASS
Band41	10MHz	16QAM	41540	1RB#0	23.59	PASS
Band41	10MHz	QPSK	41540	1RB#24	24.20	PASS
Band41	10MHz	16QAM	41540	1RB#24	23.60	PASS
Band41	10MHz	QPSK	41540	1RB#49	24.30	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	41540	1RB#49	23.72	PASS
Band41	10MHz	QPSK	41540	25RB#0	23.10	PASS
Band41	10MHz	16QAM	41540	25RB#0	22.13	PASS
Band41	10MHz	QPSK	41540	25RB#12	23.11	PASS
Band41	10MHz	16QAM	41540	25RB#12	22.14	PASS
Band41	10MHz	QPSK	41540	25RB#25	23.16	PASS
Band41	10MHz	16QAM	41540	25RB#25	22.17	PASS
Band41	10MHz	QPSK	41540	50RB#0	23.16	PASS
Band41	10MHz	16QAM	41540	50RB#0	22.29	PASS
Band41	15MHz	QPSK	39725	1RB#0	24.58	PASS
Band41	15MHz	16QAM	39725	1RB#0	24.10	PASS
Band41	15MHz	QPSK	39725	1RB#38	24.56	PASS
Band41	15MHz	16QAM	39725	1RB#38	24.13	PASS
Band41	15MHz	QPSK	39725	1RB#74	24.64	PASS
Band41	15MHz	16QAM	39725	1RB#74	23.96	PASS
Band41	15MHz	QPSK	39725	38RB#0	23.35	PASS
Band41	15MHz	16QAM	39725	38RB#0	23.35	PASS
Band41	15MHz	QPSK	39725	38RB#18	23.35	PASS
Band41	15MHz	16QAM	39725	38RB#18	23.35	PASS
Band41	15MHz	QPSK	39725	38RB#37	23.35	PASS
Band41	15MHz	16QAM	39725	38RB#37	23.46	PASS
Band41	15MHz	QPSK	39725	75RB#0	23.46	PASS
Band41	15MHz	16QAM	39725	75RB#0	22.68	PASS
Band41	15MHz	QPSK	40620	1RB#0	24.39	PASS
Band41	15MHz	16QAM	40620	1RB#0	23.89	PASS
Band41	15MHz	QPSK	40620	1RB#38	24.27	PASS
Band41	15MHz	16QAM	40620	1RB#38	23.75	PASS
Band41	15MHz	QPSK	40620	1RB#74	24.23	PASS
Band41	15MHz	16QAM	40620	1RB#74	23.81	PASS
Band41	15MHz	QPSK	40620	38RB#0	23.11	PASS
Band41	15MHz	16QAM	40620	38RB#0	23.12	PASS
Band41	15MHz	QPSK	40620	38RB#18	23.13	PASS
Band41	15MHz	16QAM	40620	38RB#18	23.13	PASS
Band41	15MHz	QPSK	40620	38RB#37	23.31	PASS
Band41	15MHz	16QAM	40620	38RB#37	23.31	PASS
Band41	15MHz	QPSK	40620	75RB#0	23.28	PASS
Band41	15MHz	16QAM	40620	75RB#0	22.33	PASS
Band41	15MHz	QPSK	41515	1RB#0	24.09	PASS
Band41	15MHz	16QAM	41515	1RB#0	23.66	PASS
Band41	15MHz	QPSK	41515	1RB#38	24.21	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#38	23.74	PASS
Band41	15MHz	QPSK	41515	1RB#74	24.37	PASS
Band41	15MHz	16QAM	41515	1RB#74	23.70	PASS
Band41	15MHz	QPSK	41515	38RB#0	23.05	PASS
Band41	15MHz	16QAM	41515	38RB#0	23.04	PASS
Band41	15MHz	QPSK	41515	38RB#18	23.04	PASS
Band41	15MHz	16QAM	41515	38RB#18	23.03	PASS
Band41	15MHz	QPSK	41515	38RB#37	23.03	PASS
Band41	15MHz	16QAM	41515	38RB#37	23.03	PASS
Band41	15MHz	QPSK	41515	75RB#0	23.03	PASS
Band41	15MHz	16QAM	41515	75RB#0	22.32	PASS
Band41	20MHz	QPSK	39750	1RB#0	24.43	PASS
Band41	20MHz	16QAM	39750	1RB#0	24.09	PASS
Band41	20MHz	QPSK	39750	1RB#49	24.37	PASS
Band41	20MHz	16QAM	39750	1RB#49	24.07	PASS
Band41	20MHz	QPSK	39750	1RB#99	24.40	PASS
Band41	20MHz	16QAM	39750	1RB#99	24.16	PASS
Band41	20MHz	QPSK	39750	50RB#0	23.42	PASS
Band41	20MHz	16QAM	39750	50RB#0	22.69	PASS
Band41	20MHz	QPSK	39750	50RB#25	23.32	PASS
Band41	20MHz	16QAM	39750	50RB#25	22.65	PASS
Band41	20MHz	QPSK	39750	50RB#50	23.44	PASS
Band41	20MHz	16QAM	39750	50RB#50	22.79	PASS
Band41	20MHz	QPSK	39750	100RB#0	23.44	PASS
Band41	20MHz	16QAM	39750	100RB#0	22.57	PASS
Band41	20MHz	QPSK	40620	1RB#0	24.10	PASS
Band41	20MHz	16QAM	40620	1RB#0	23.87	PASS
Band41	20MHz	QPSK	40620	1RB#49	24.15	PASS
Band41	20MHz	16QAM	40620	1RB#49	23.77	PASS
Band41	20MHz	QPSK	40620	1RB#99	23.97	PASS
Band41	20MHz	16QAM	40620	1RB#99	23.77	PASS
Band41	20MHz	QPSK	40620	50RB#0	23.29	PASS
Band41	20MHz	16QAM	40620	50RB#0	22.44	PASS
Band41	20MHz	QPSK	40620	50RB#25	23.14	PASS
Band41	20MHz	16QAM	40620	50RB#25	22.45	PASS
Band41	20MHz	QPSK	40620	50RB#50	23.13	PASS
Band41	20MHz	16QAM	40620	50RB#50	22.44	PASS
Band41	20MHz	QPSK	40620	100RB#0	23.22	PASS
Band41	20MHz	16QAM	40620	100RB#0	22.32	PASS
Band41	20MHz	QPSK	41490	1RB#0	24.08	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	23.74	PASS
Band41	20MHz	QPSK	41490	1RB#49	23.91	PASS
Band41	20MHz	16QAM	41490	1RB#49	23.68	PASS
Band41	20MHz	QPSK	41490	1RB#99	24.05	PASS
Band41	20MHz	16QAM	41490	1RB#99	23.72	PASS
Band41	20MHz	QPSK	41490	50RB#0	23.01	PASS
Band41	20MHz	16QAM	41490	50RB#0	22.33	PASS
Band41	20MHz	QPSK	41490	50RB#25	23.01	PASS
Band41	20MHz	16QAM	41490	50RB#25	22.33	PASS
Band41	20MHz	QPSK	41490	50RB#50	23.17	PASS
Band41	20MHz	16QAM	41490	50RB#50	22.28	PASS
Band41	20MHz	QPSK	41490	100RB#0	23.10	PASS
Band41	20MHz	16QAM	41490	100RB#0	22.20	PASS





P.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	7.40	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	7.83	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.83	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.69	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.32	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	9.14	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.20	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.85	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	7.45	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.26	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	8.85	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.76	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	7.33	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.32	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.16	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.99	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	7.83	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.00	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.16	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.90	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	7.37	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.36	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.07	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	10.04	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	7.37	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.14	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.66	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	10.10	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	7.91	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	9.07	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.25	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	10.05	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	7.60	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	8.38	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.27	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	41515	75RB#0	9.88	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	7.55	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	7.49	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.52	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.86	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	7.87	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.69	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.23	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	10.34	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	7.73	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	7.77	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	9.41	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.61	13	PASS





Test Graphs




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

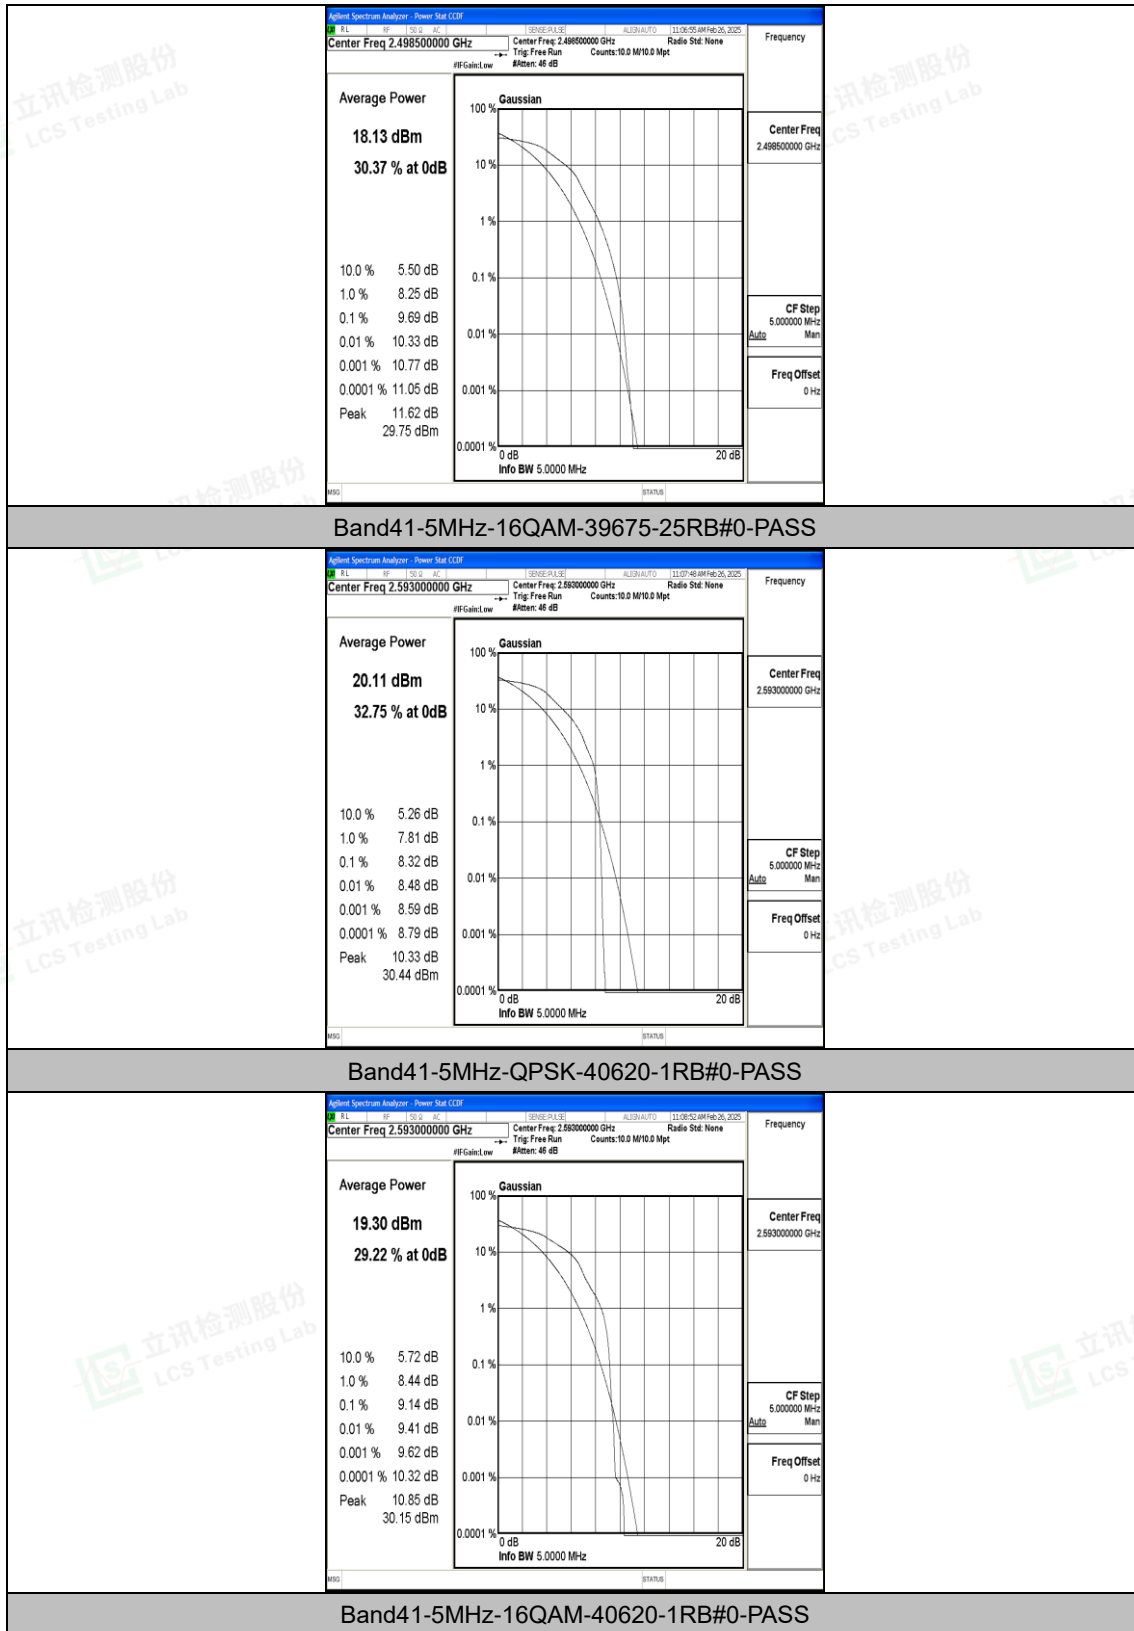


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

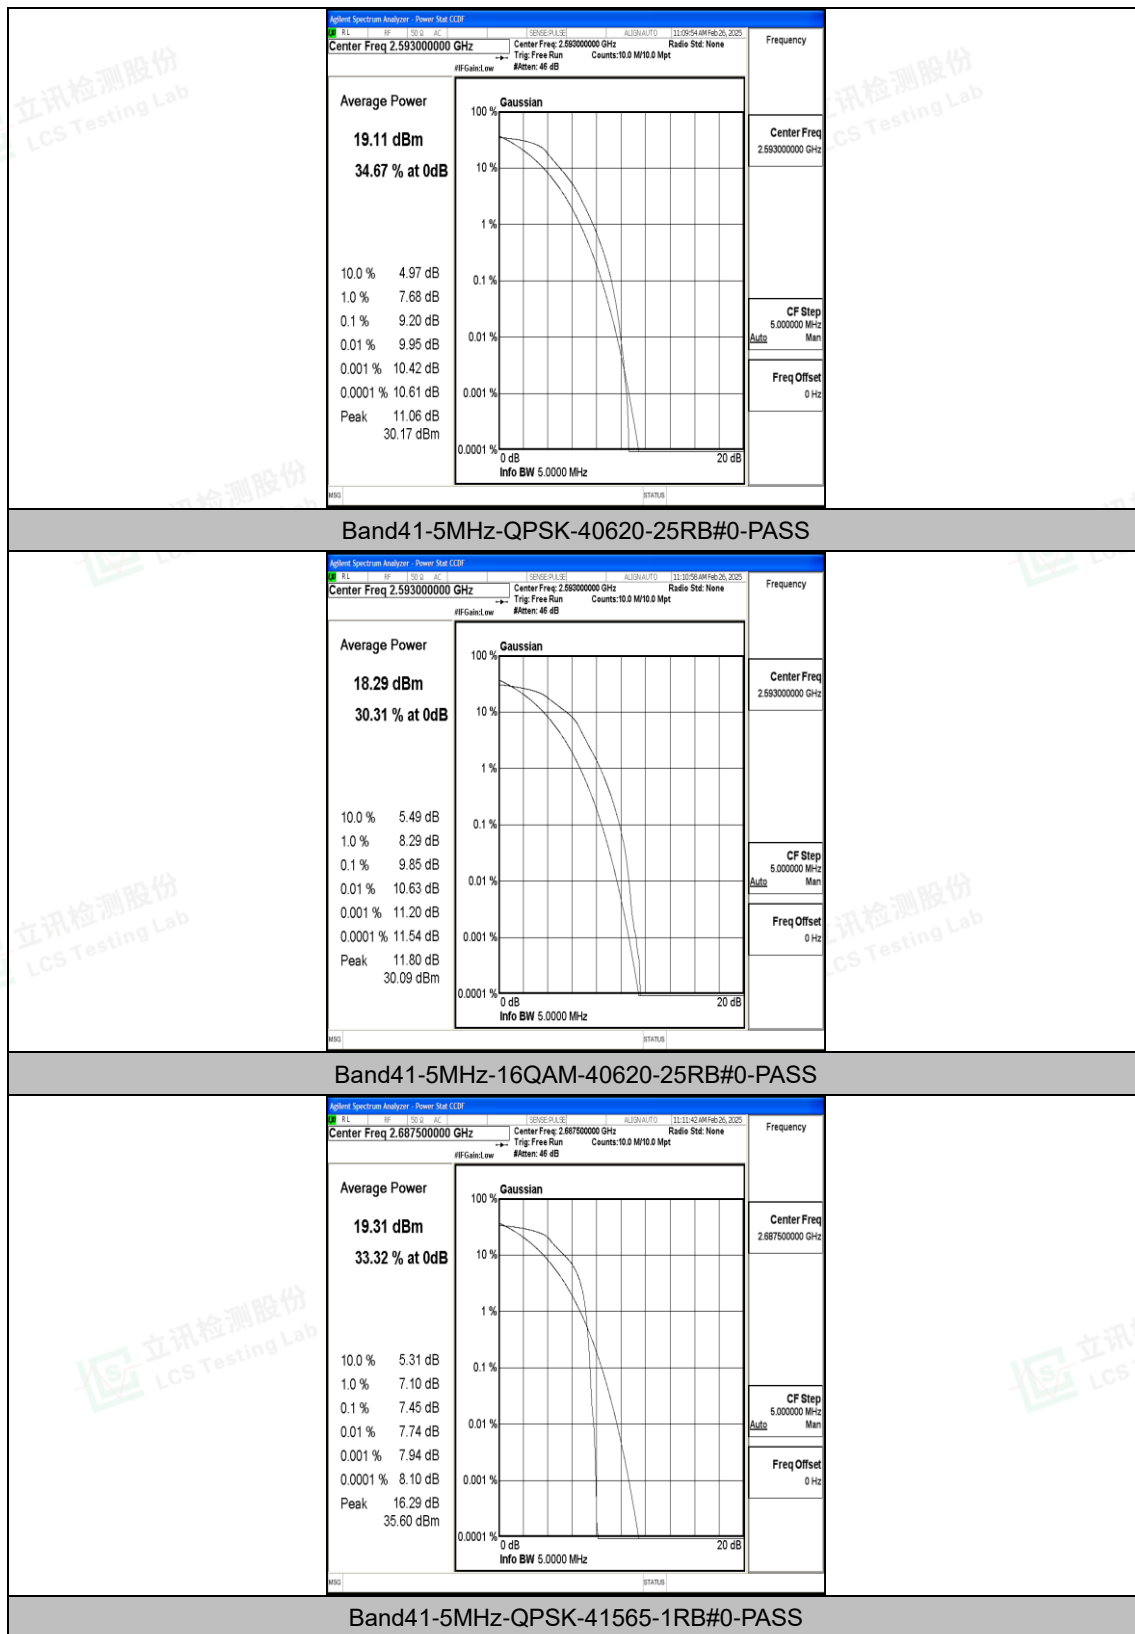


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

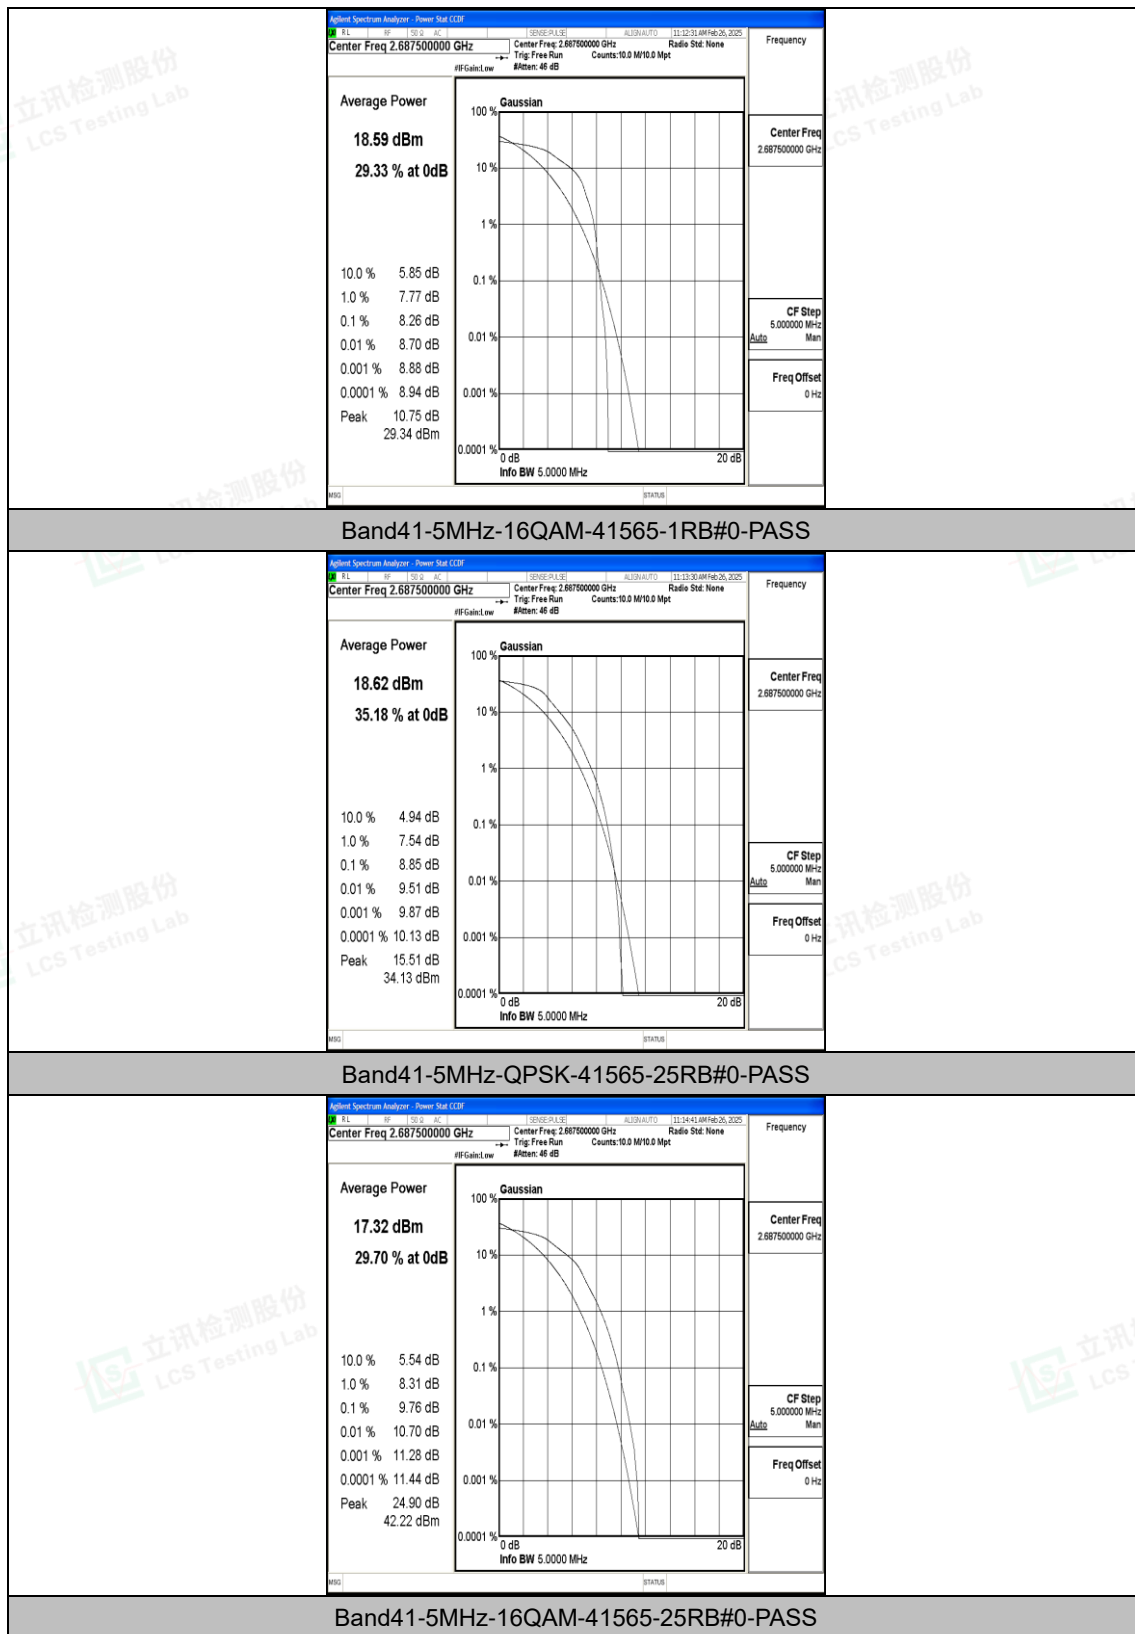



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

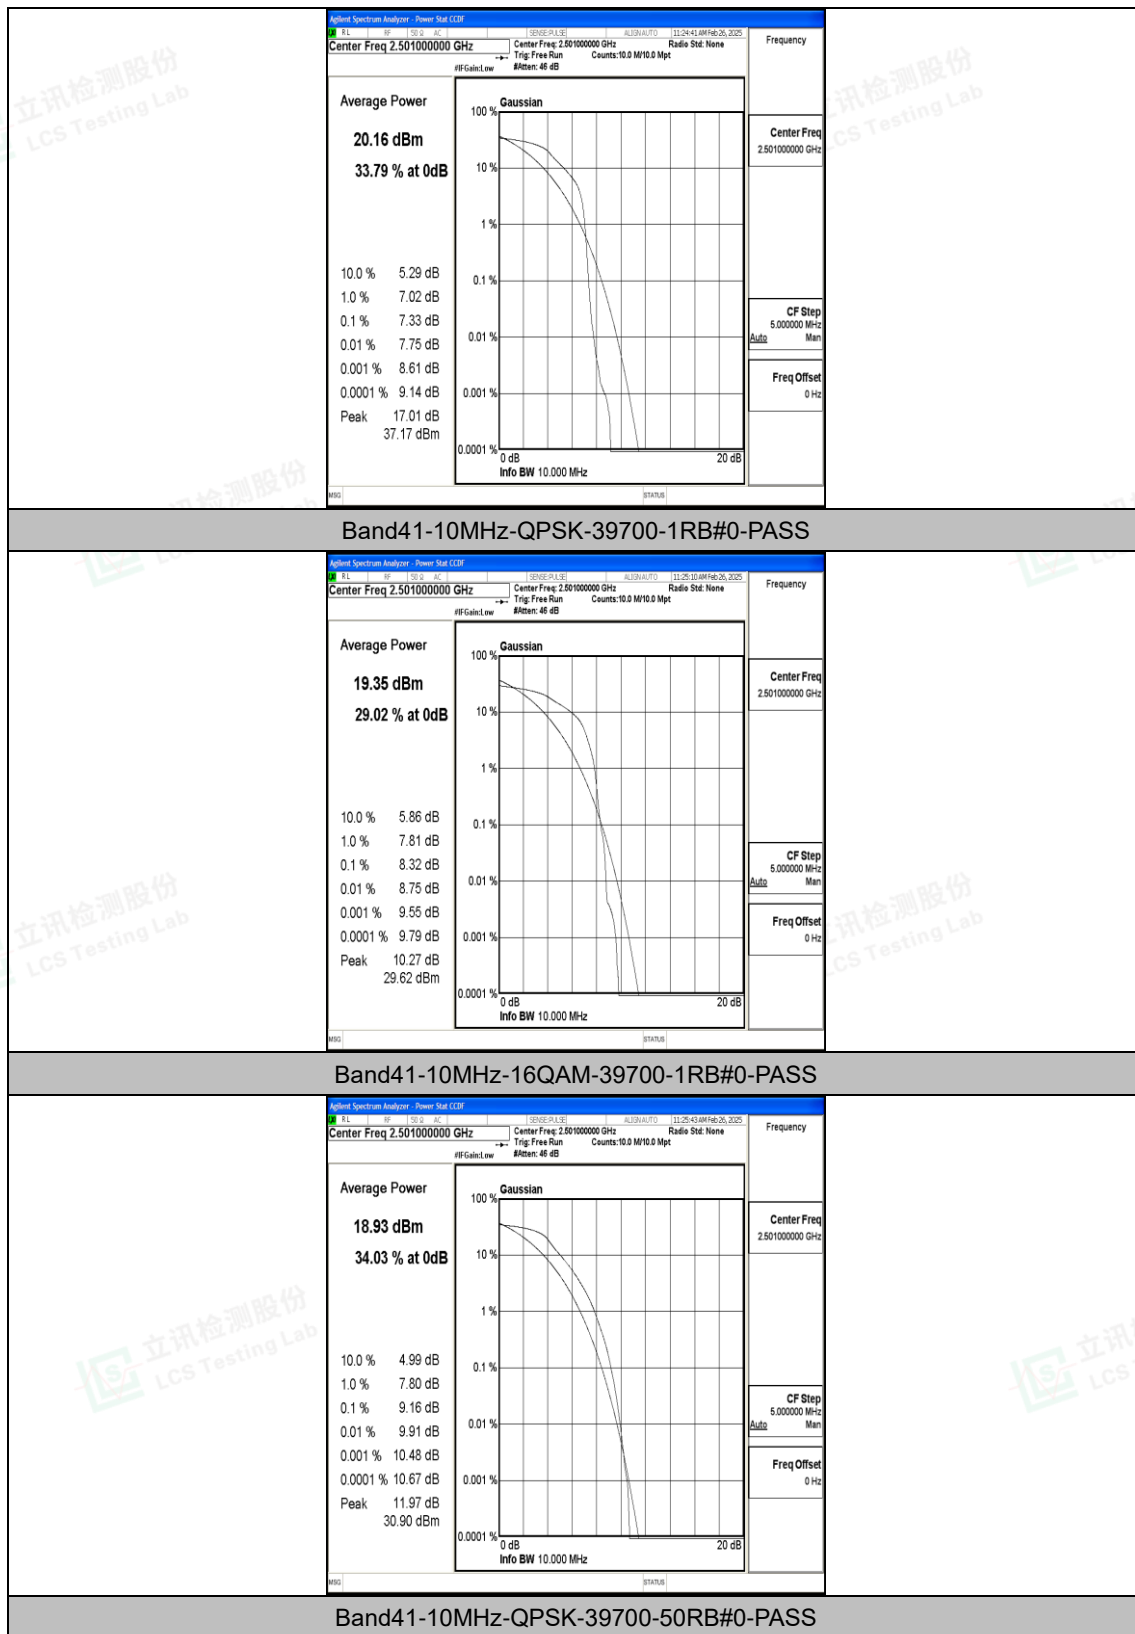

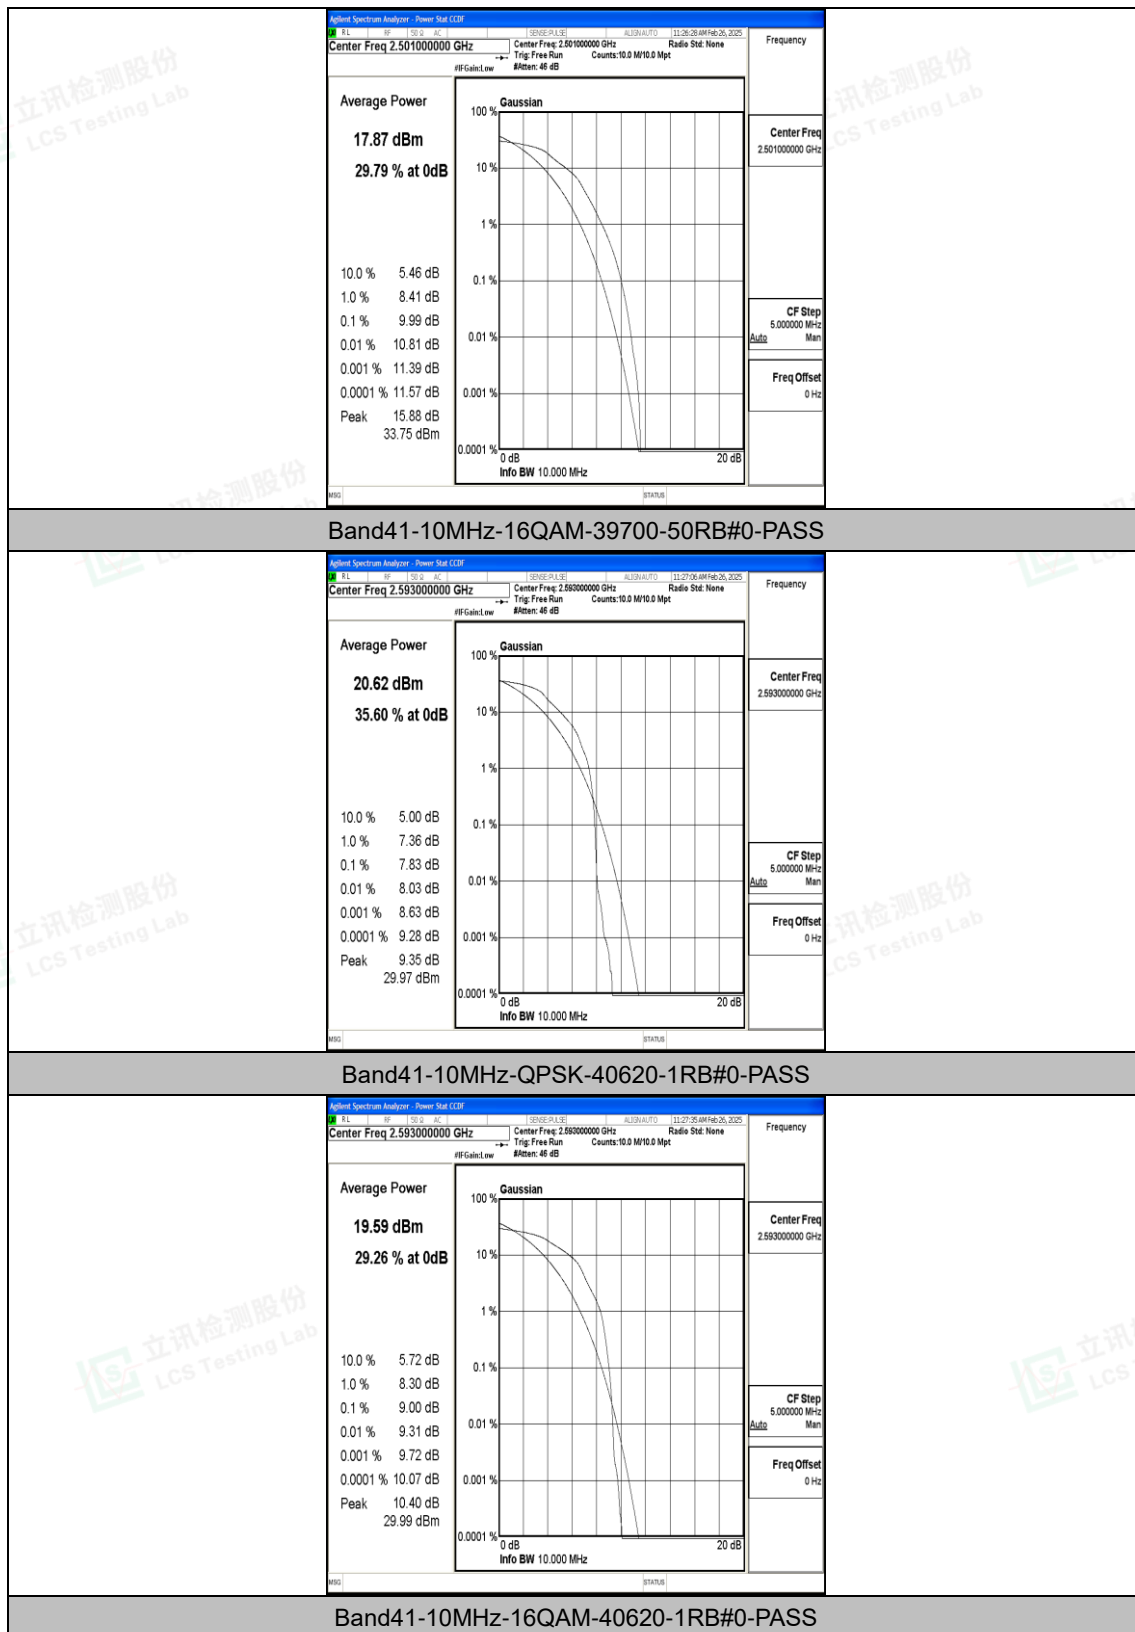


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

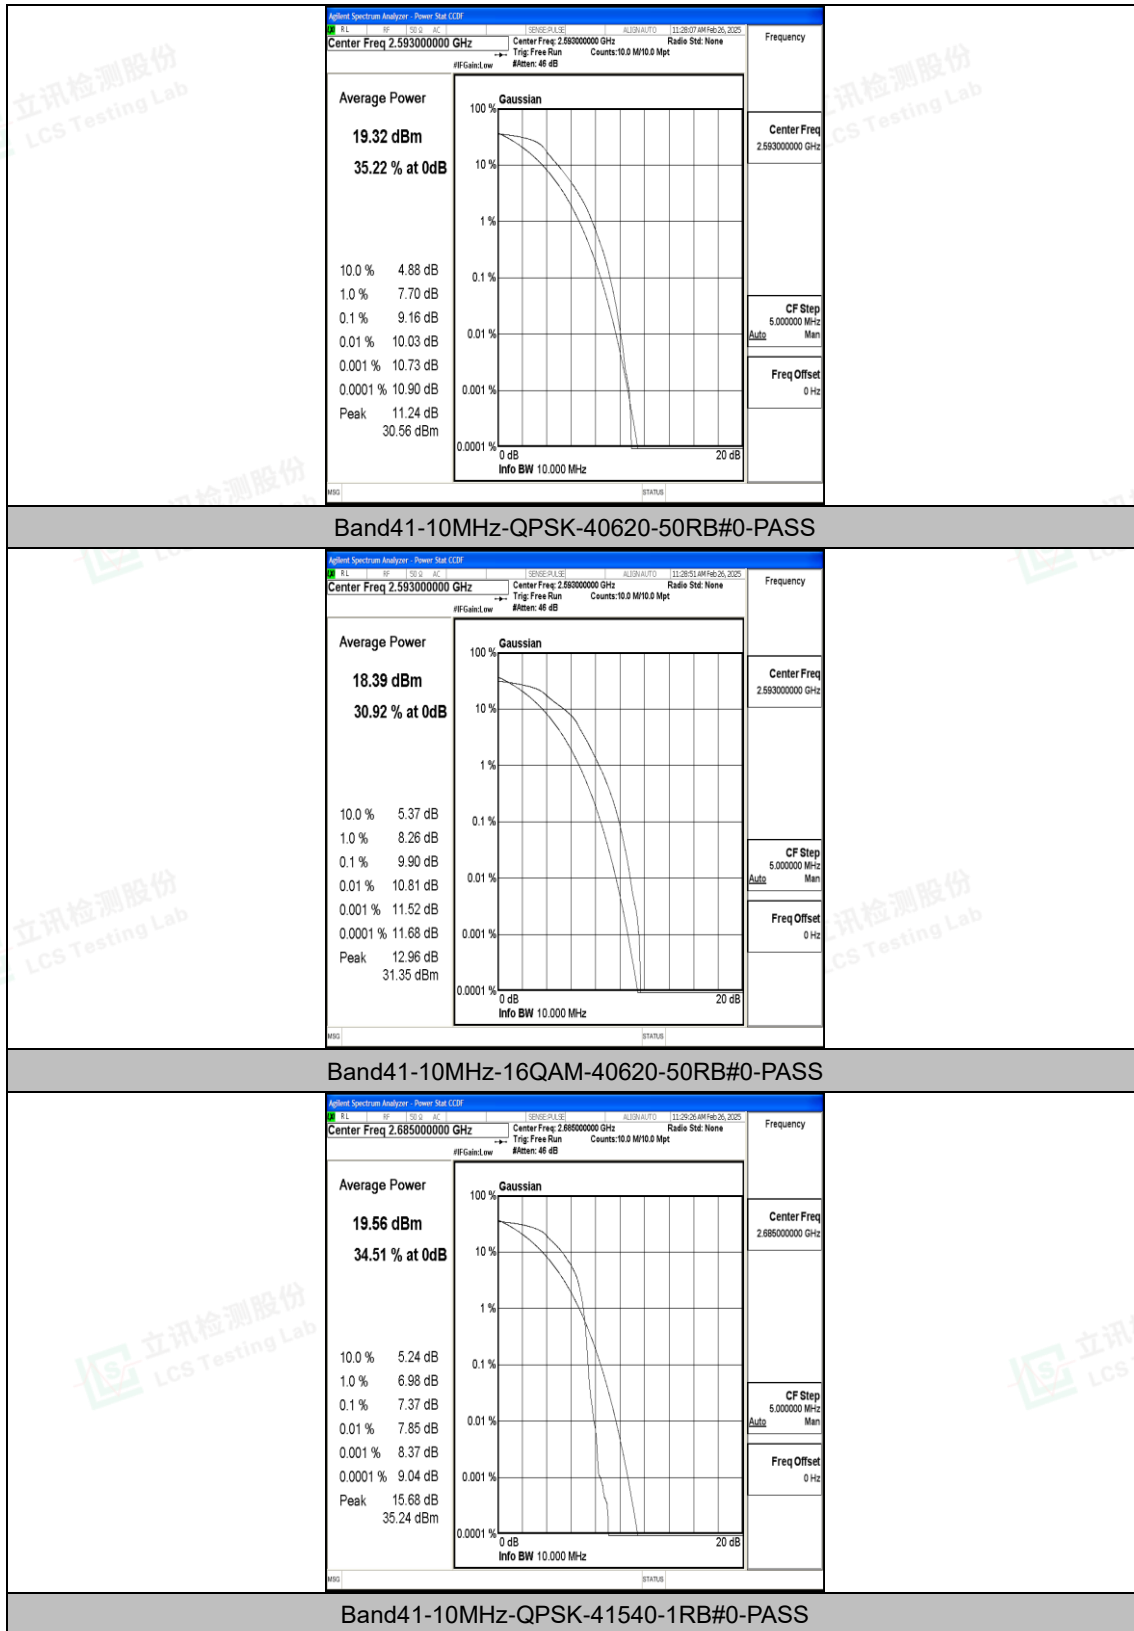


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

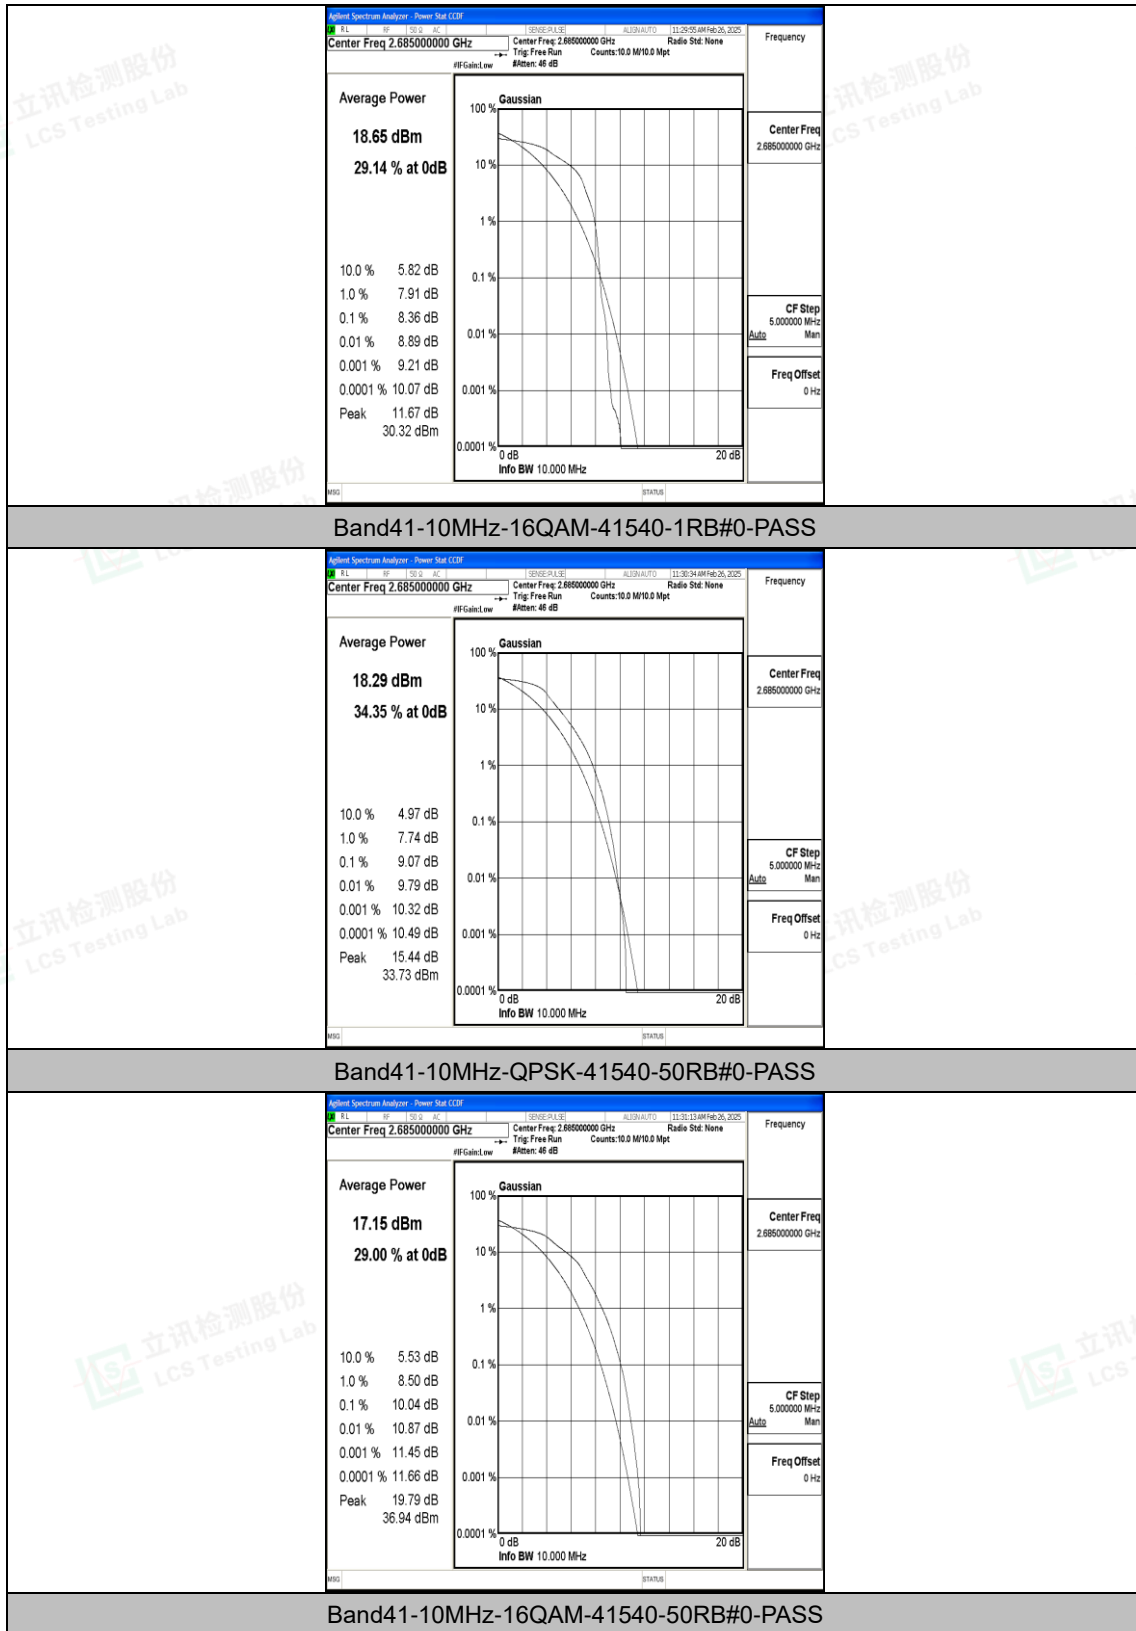


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

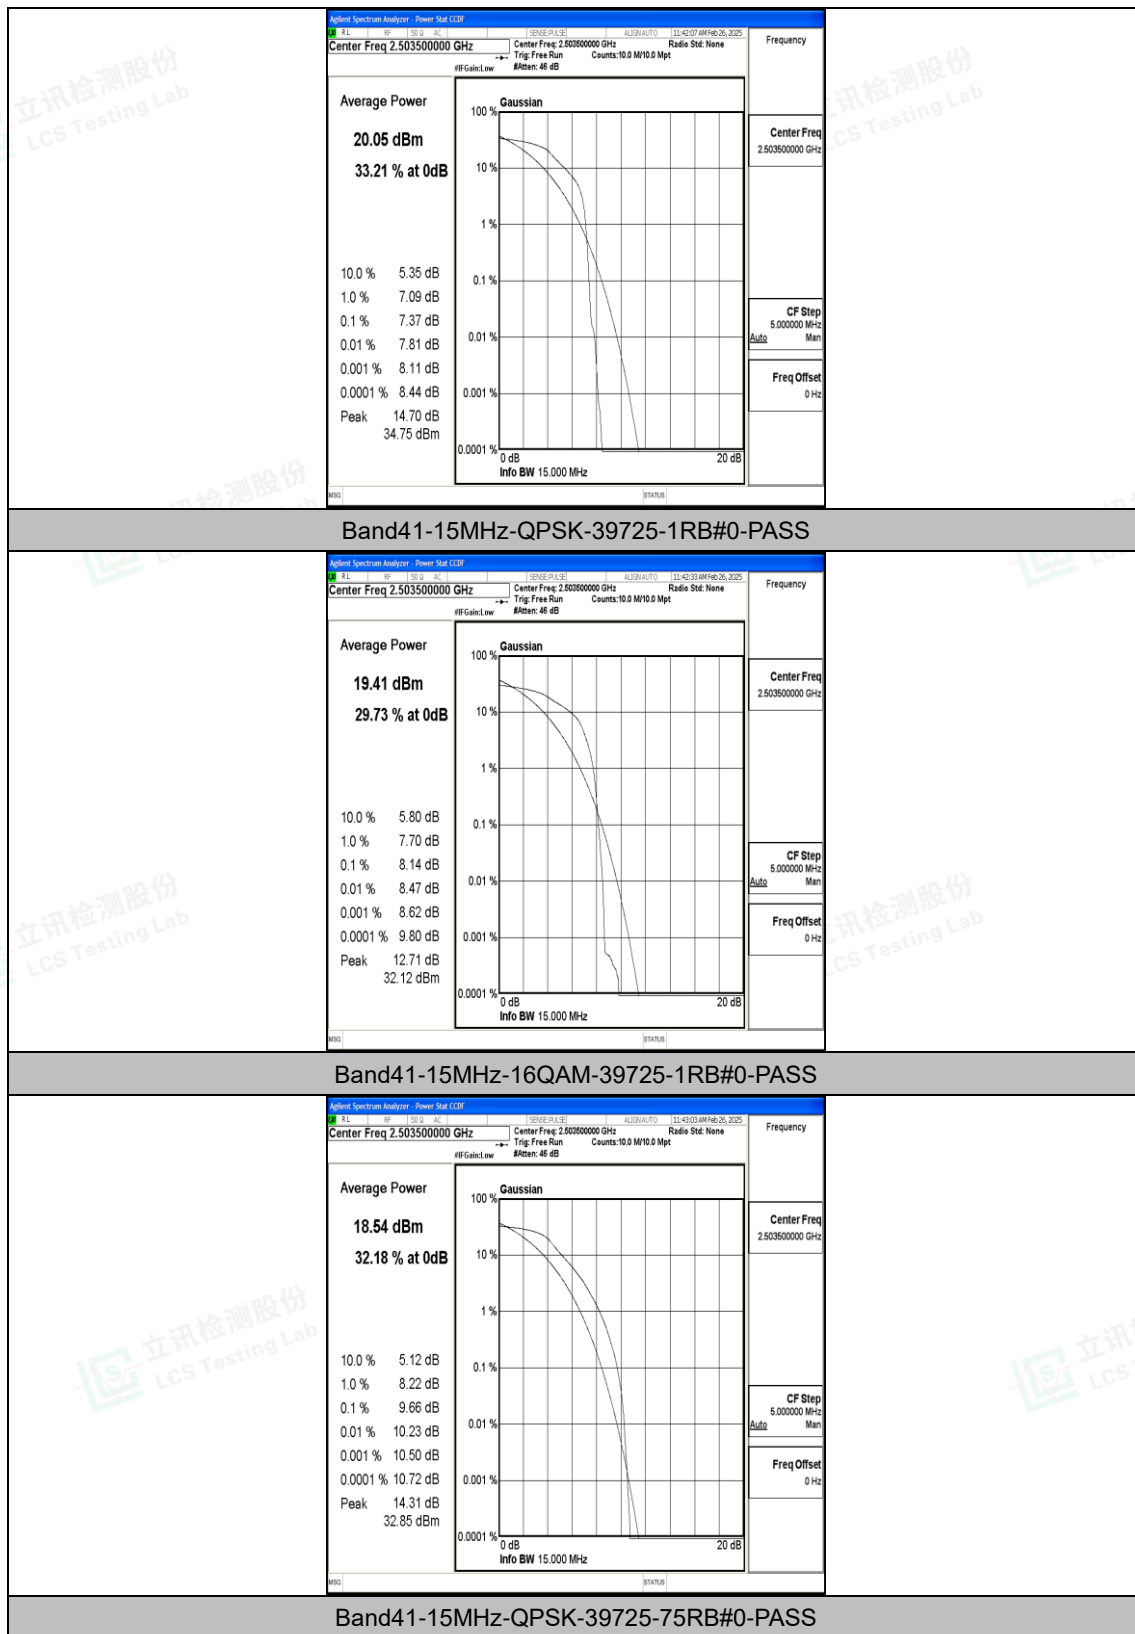


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

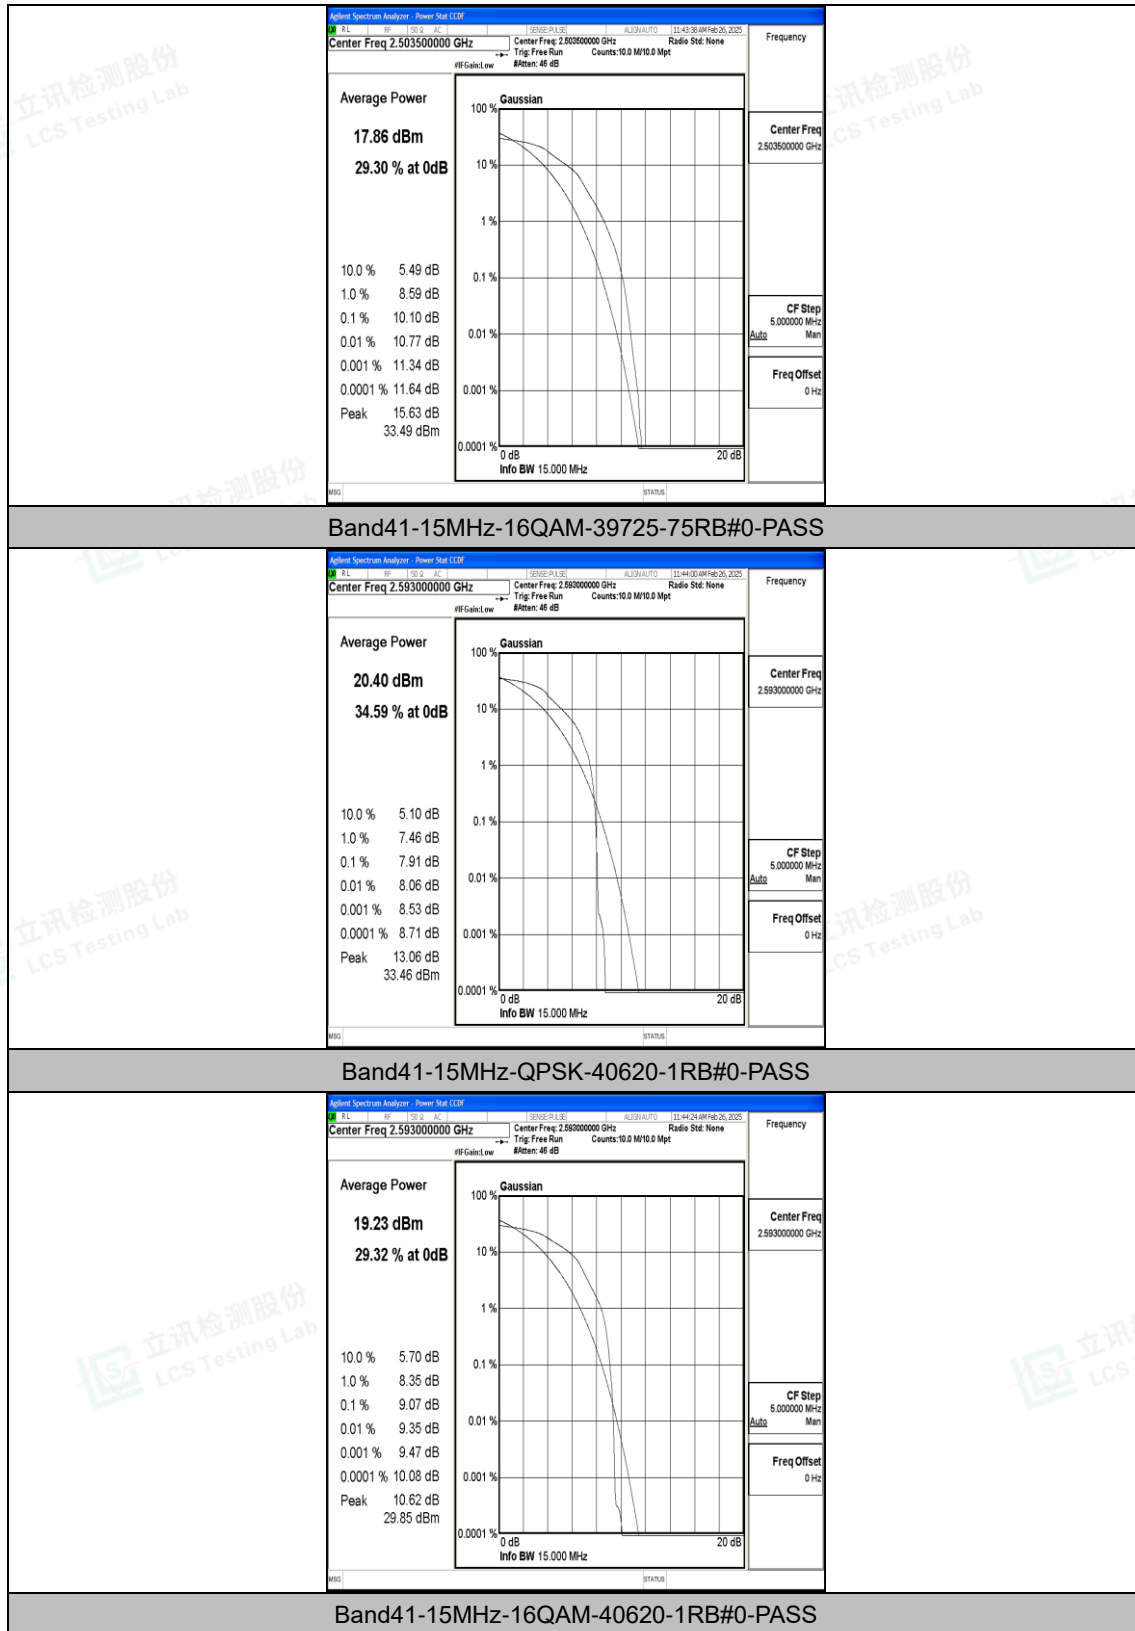


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

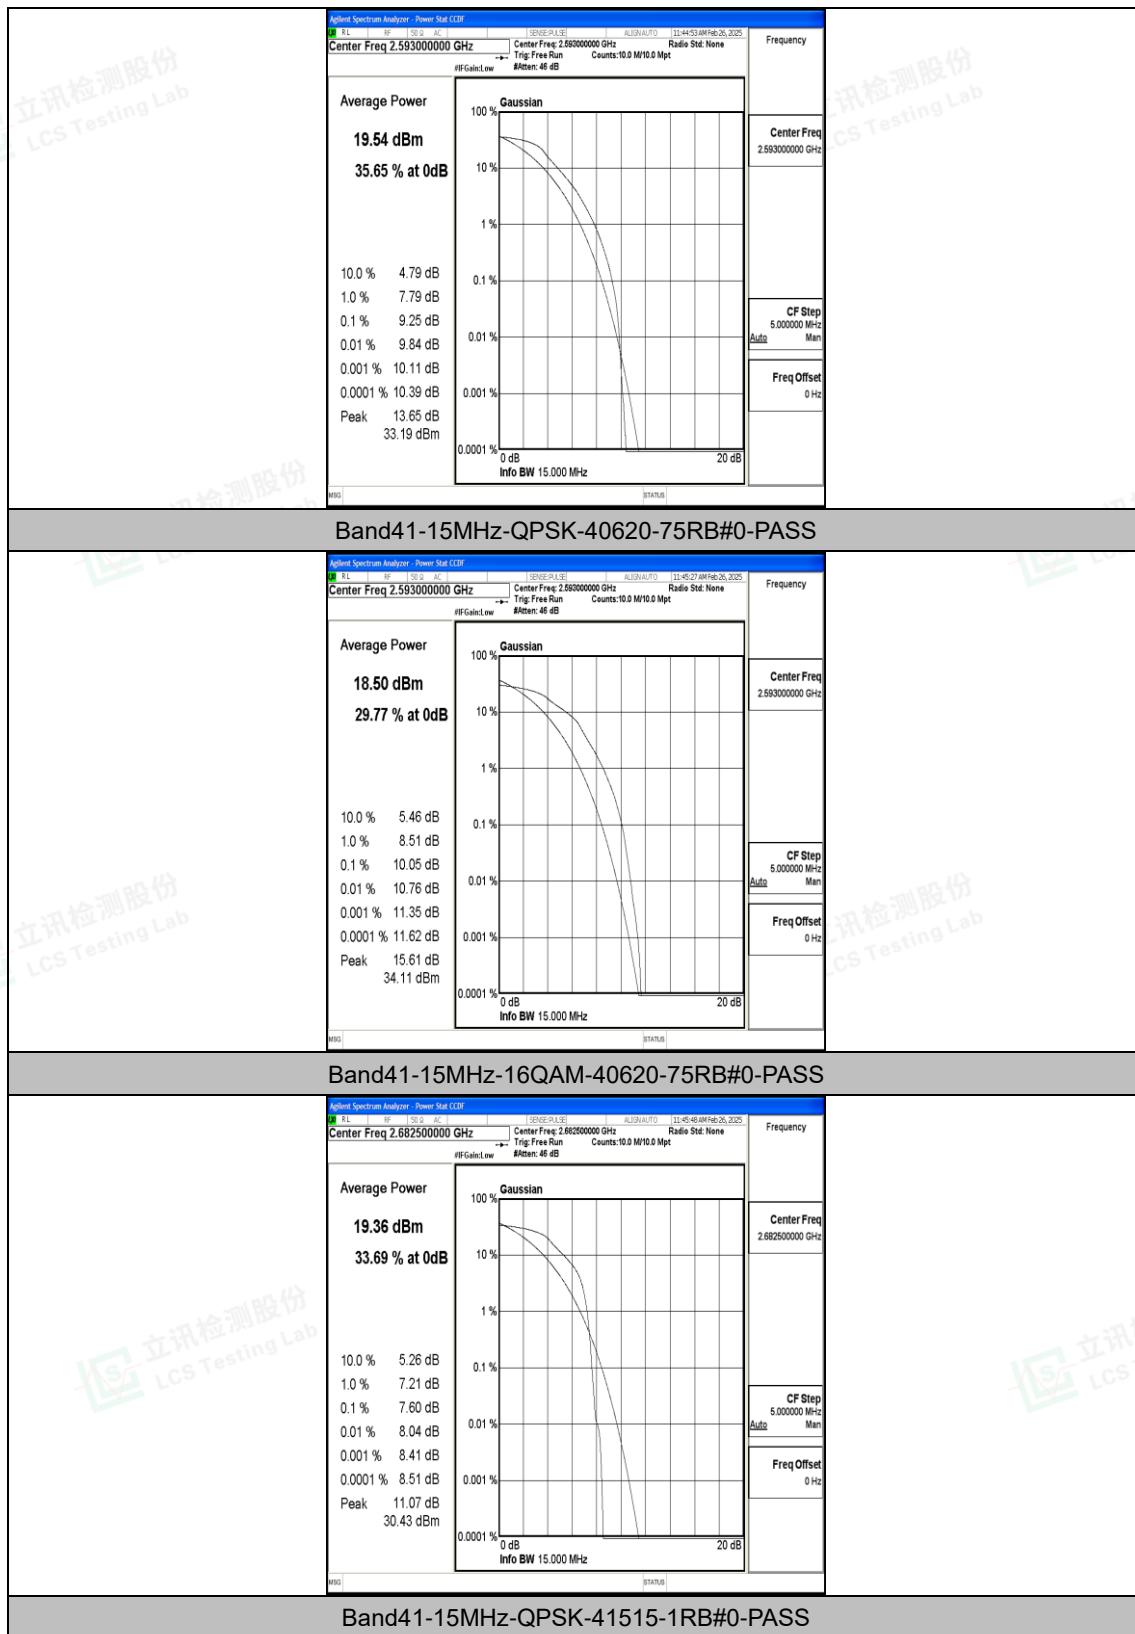


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

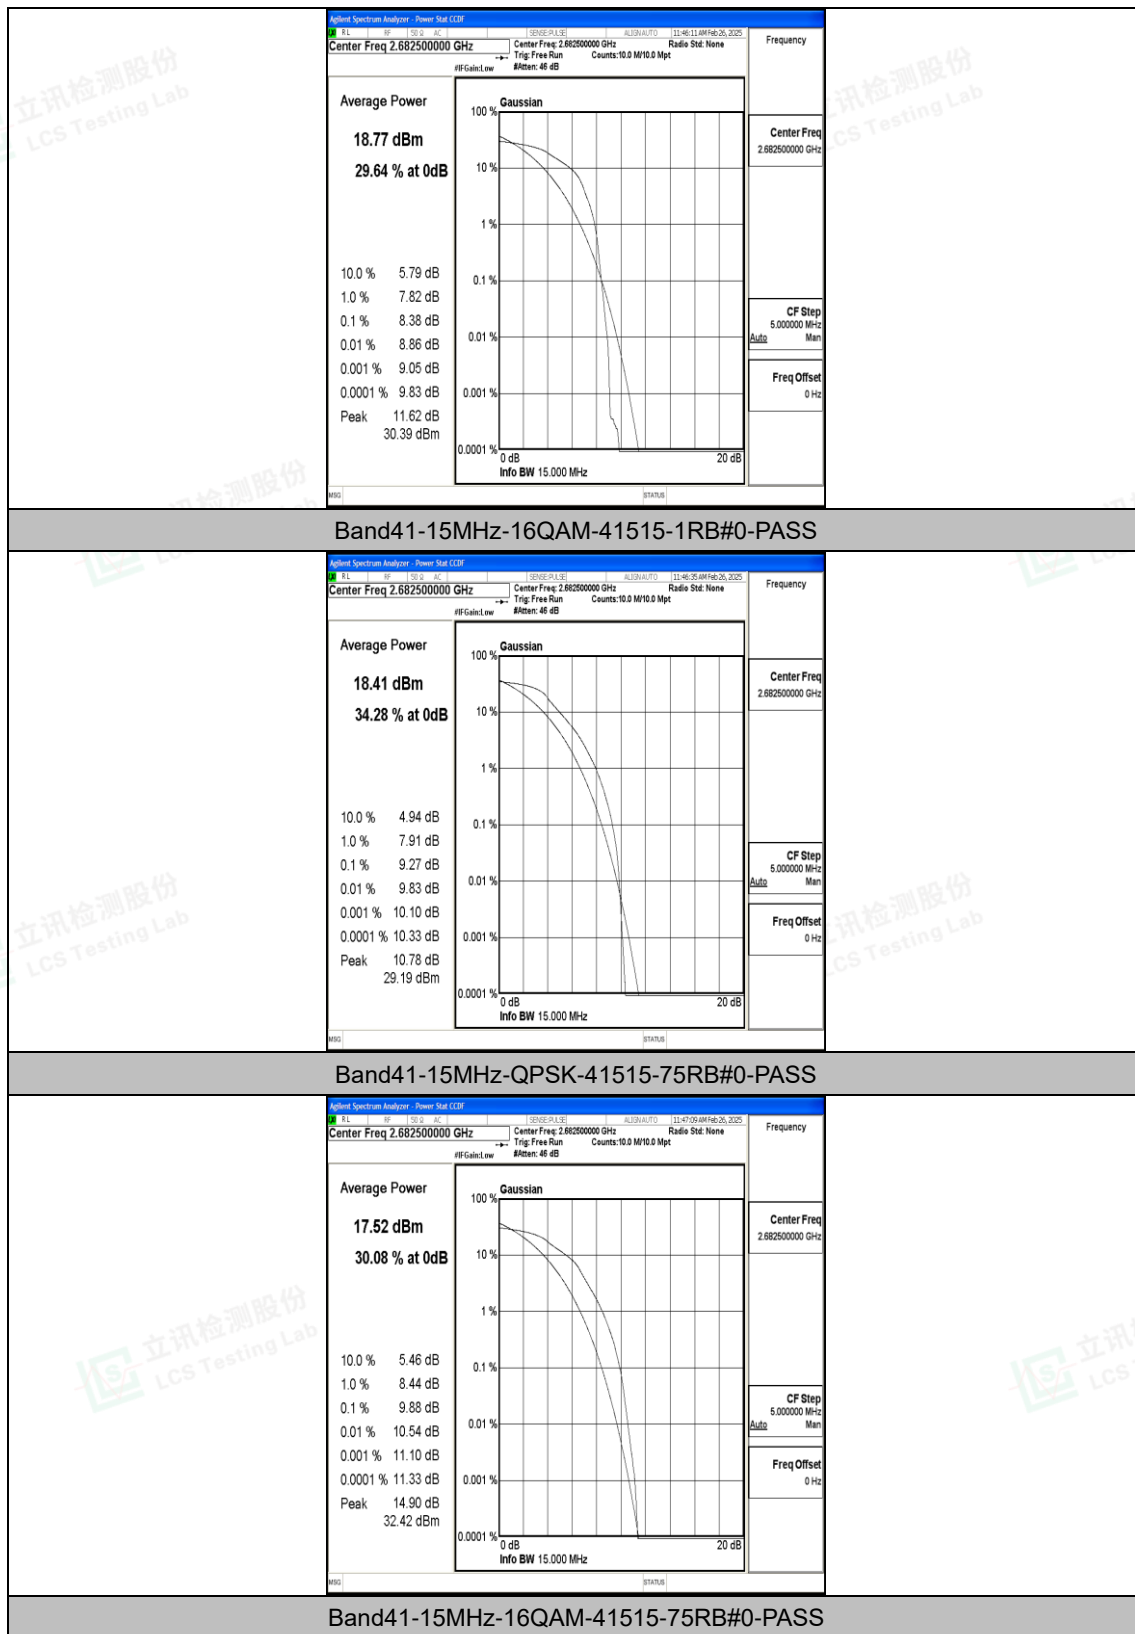


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

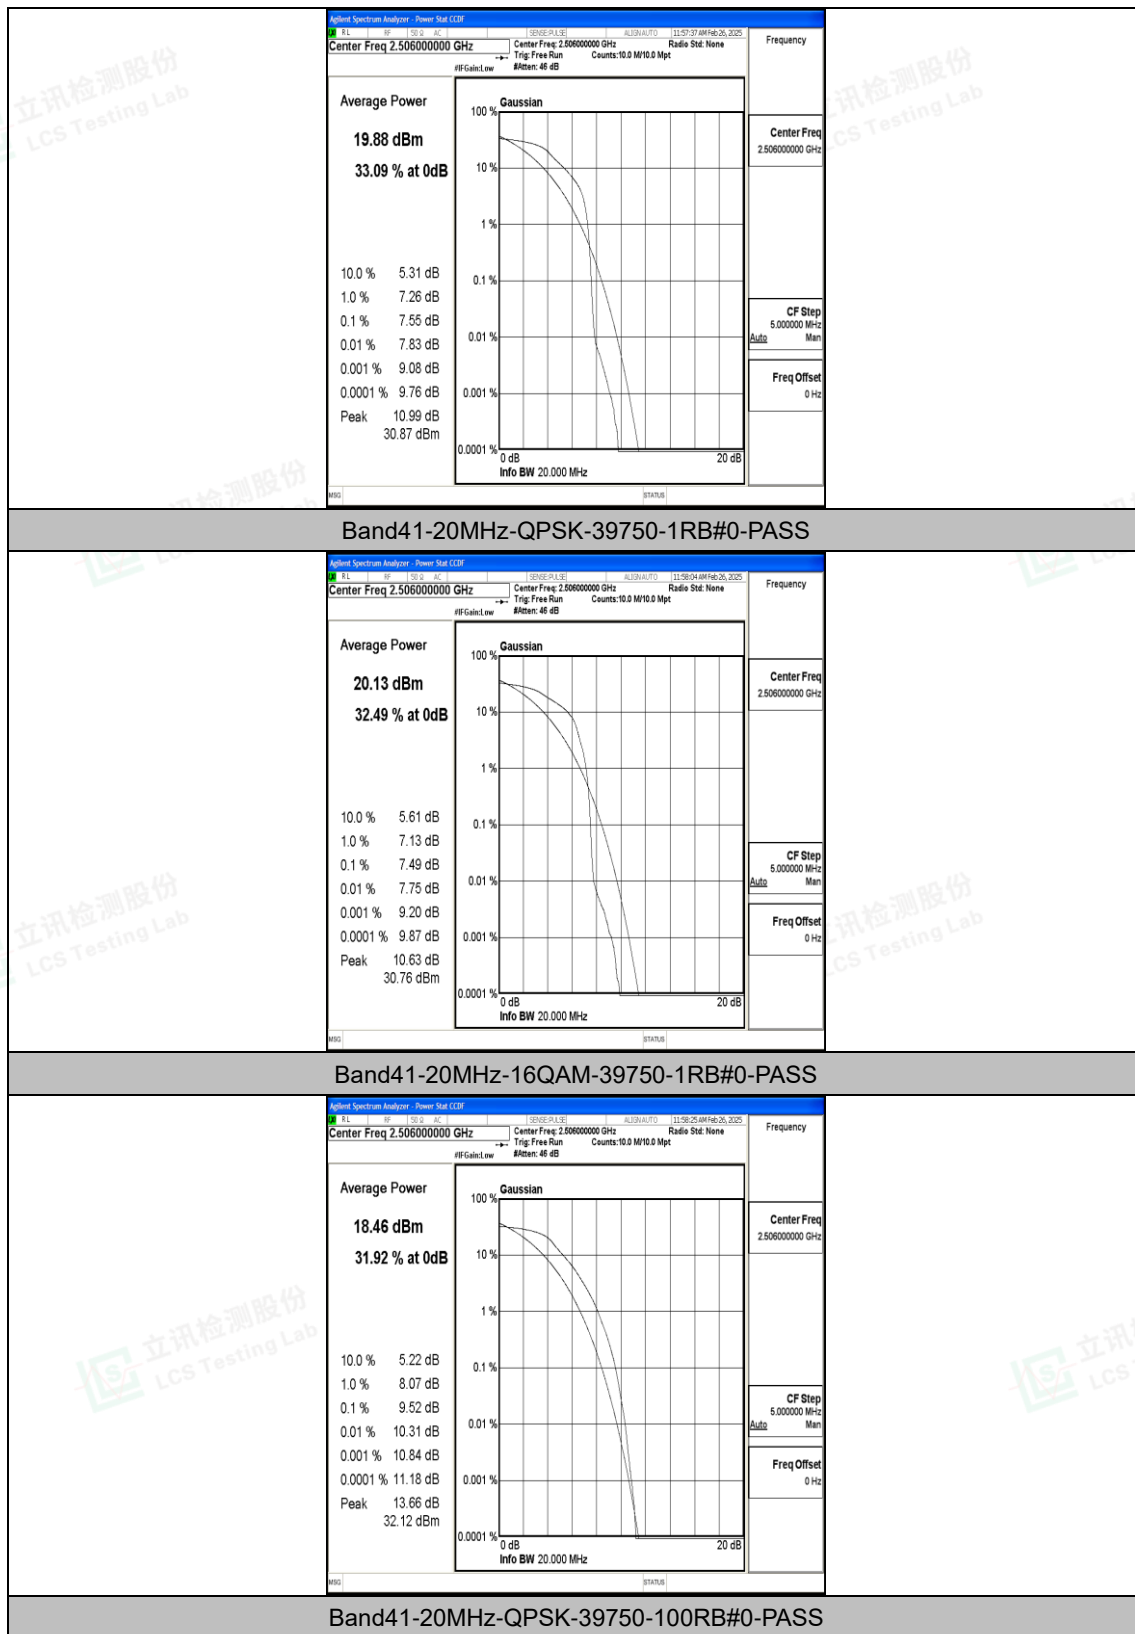


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

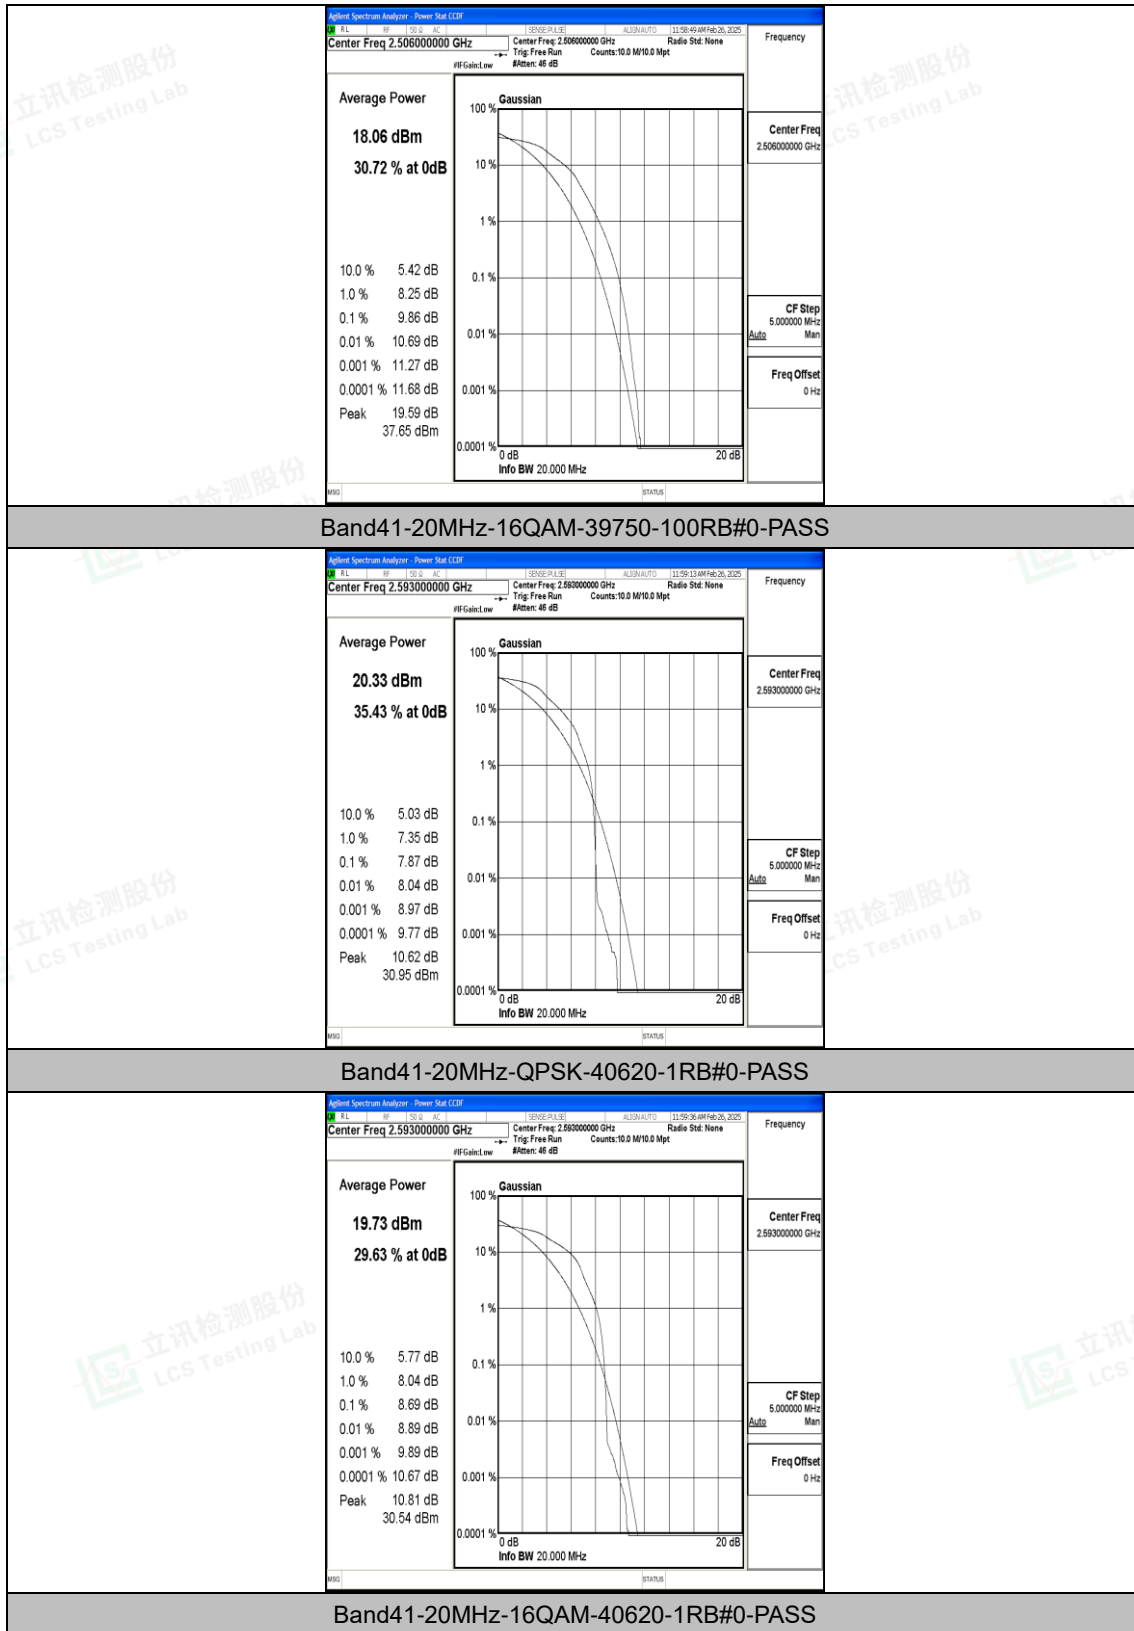


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

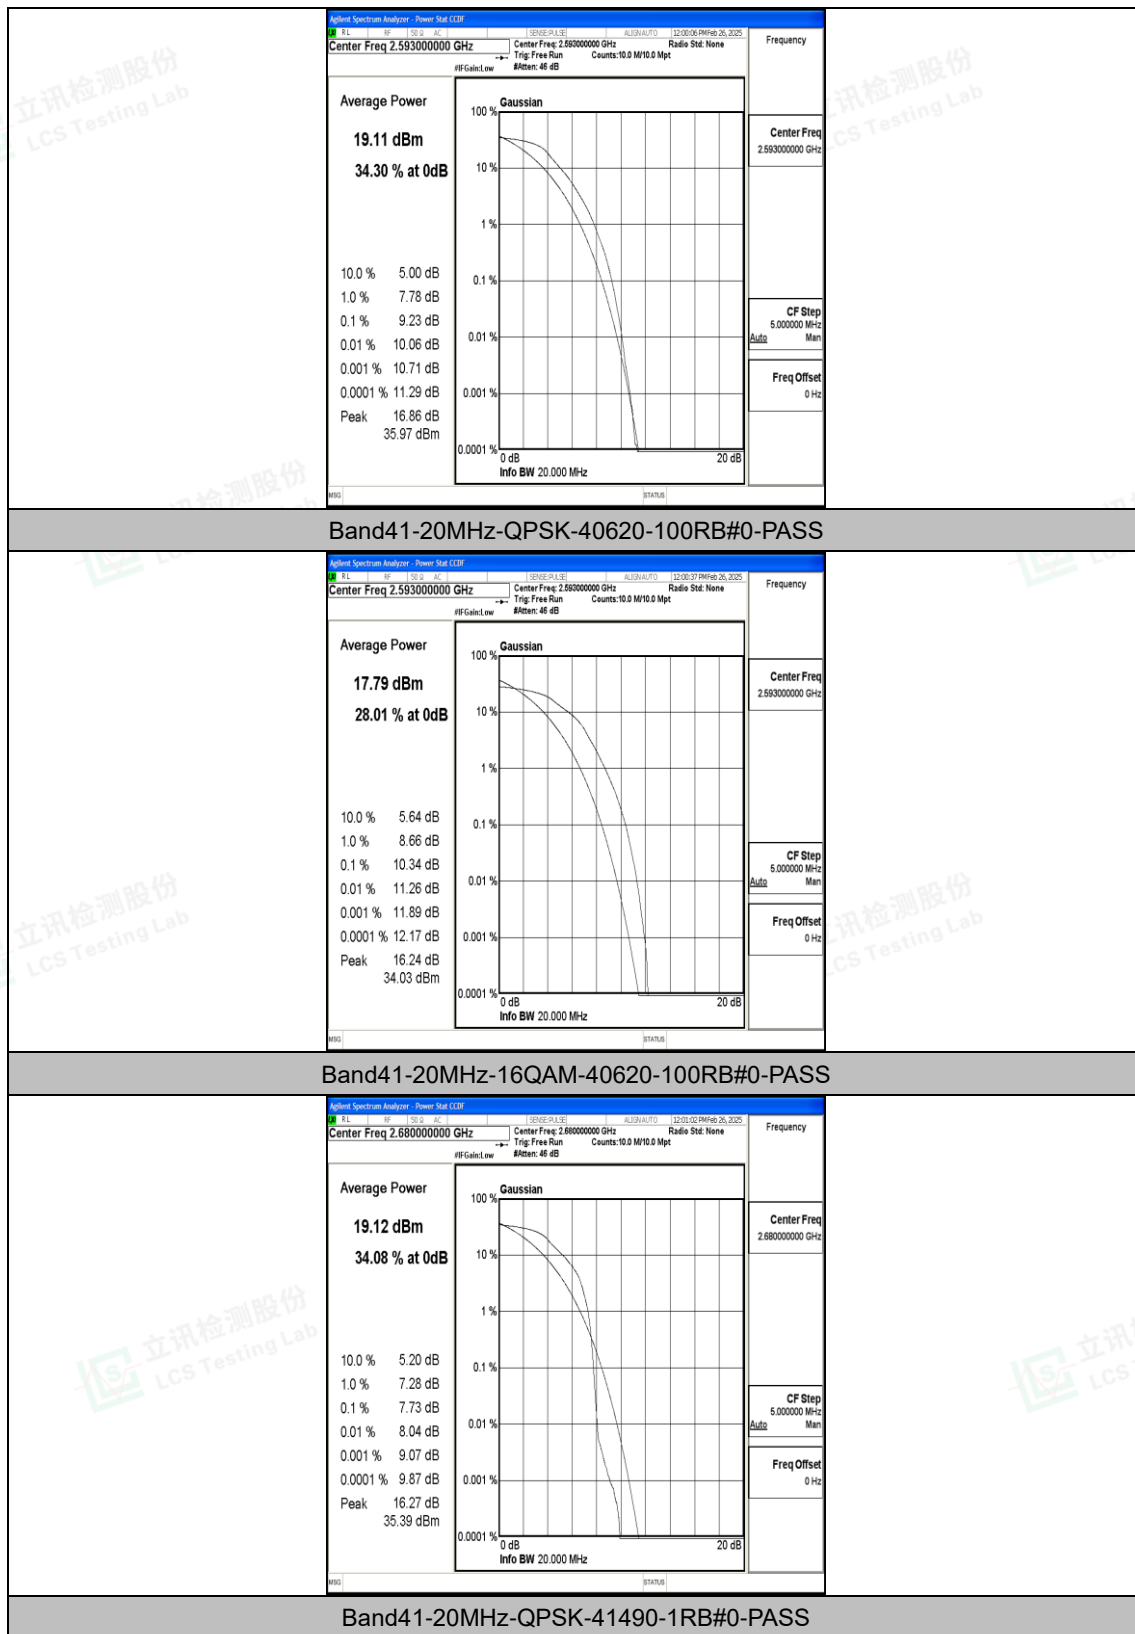


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

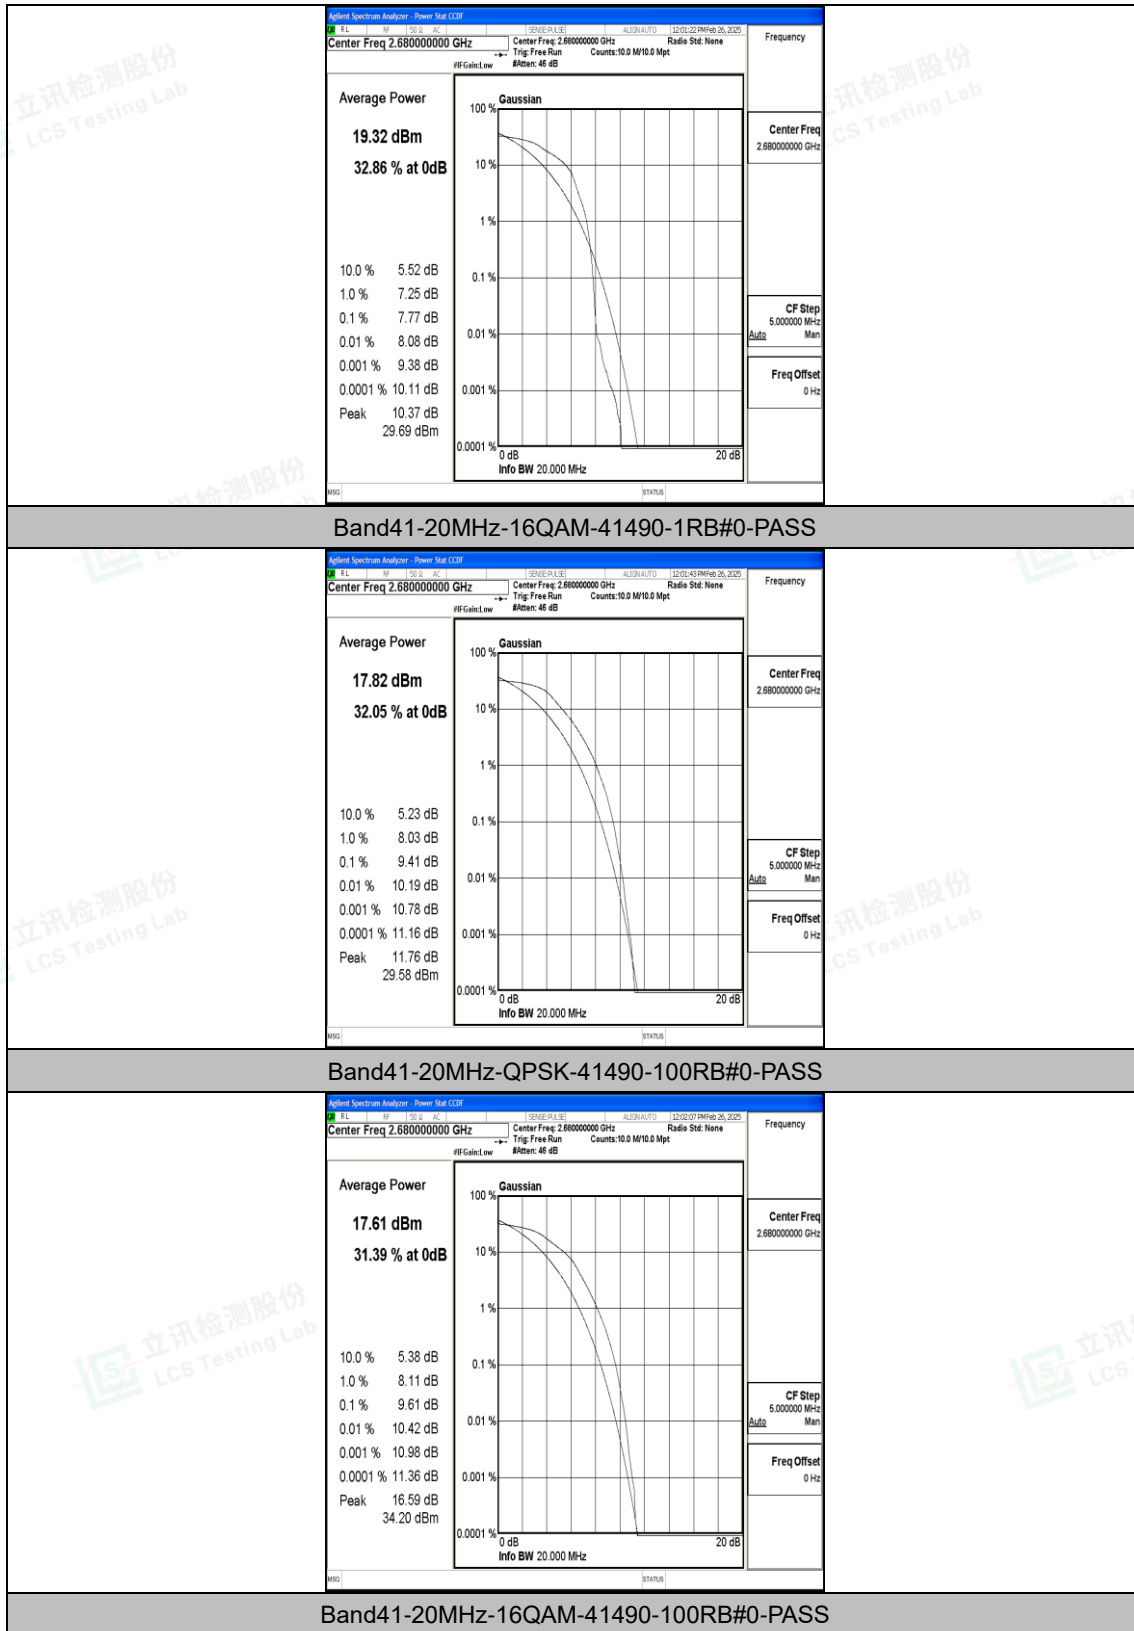

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



P.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5070	5.358	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5168	5.194	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5114	5.362	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5141	5.143	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4912	4.966	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.4914	4.945	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.0192	10.49	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9811	10.01	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0103	10.77	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9958	10.01	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0181	10.60	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0143	9.803	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.487	16.91	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.515	14.78	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.476	15.85	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.497	14.85	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.523	15.70	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.513	15.14	PASS
Band41	20MHz	QPSK	39750	100RB#0	18.090	19.36	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.938	19.84	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.986	19.78	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.962	19.87	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.954	19.78	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.986	19.32	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

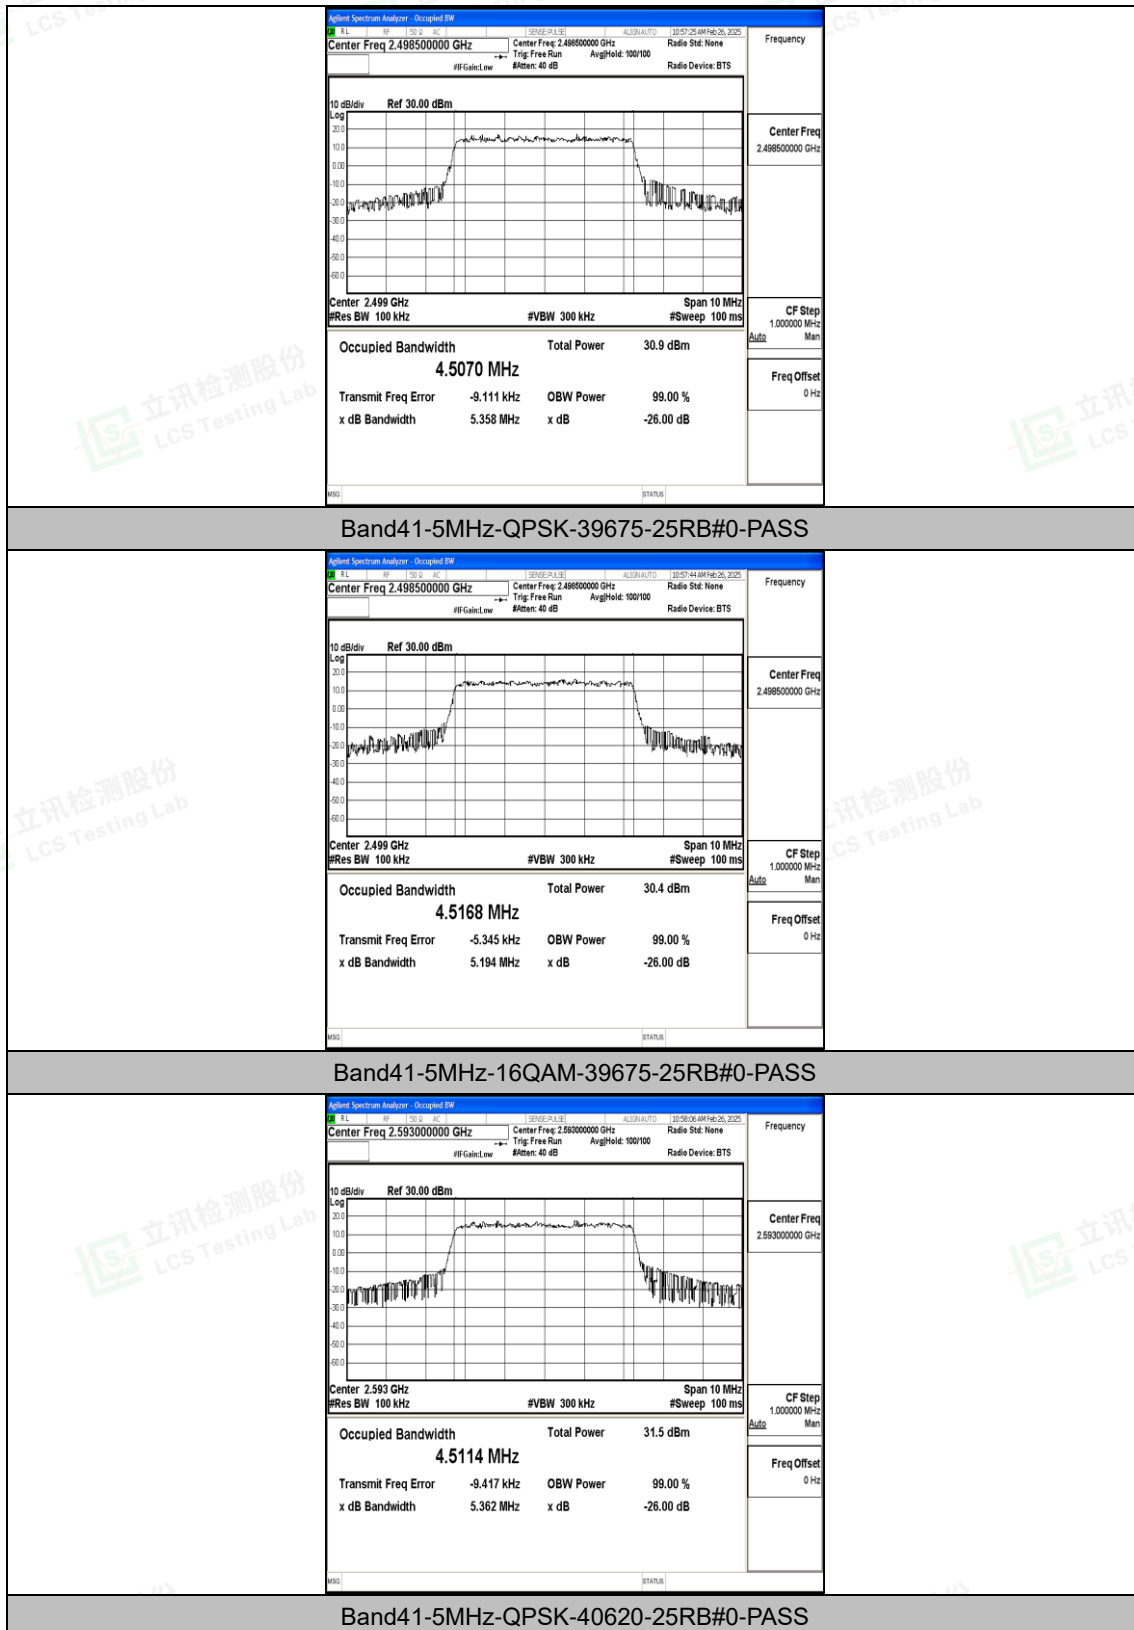

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

