


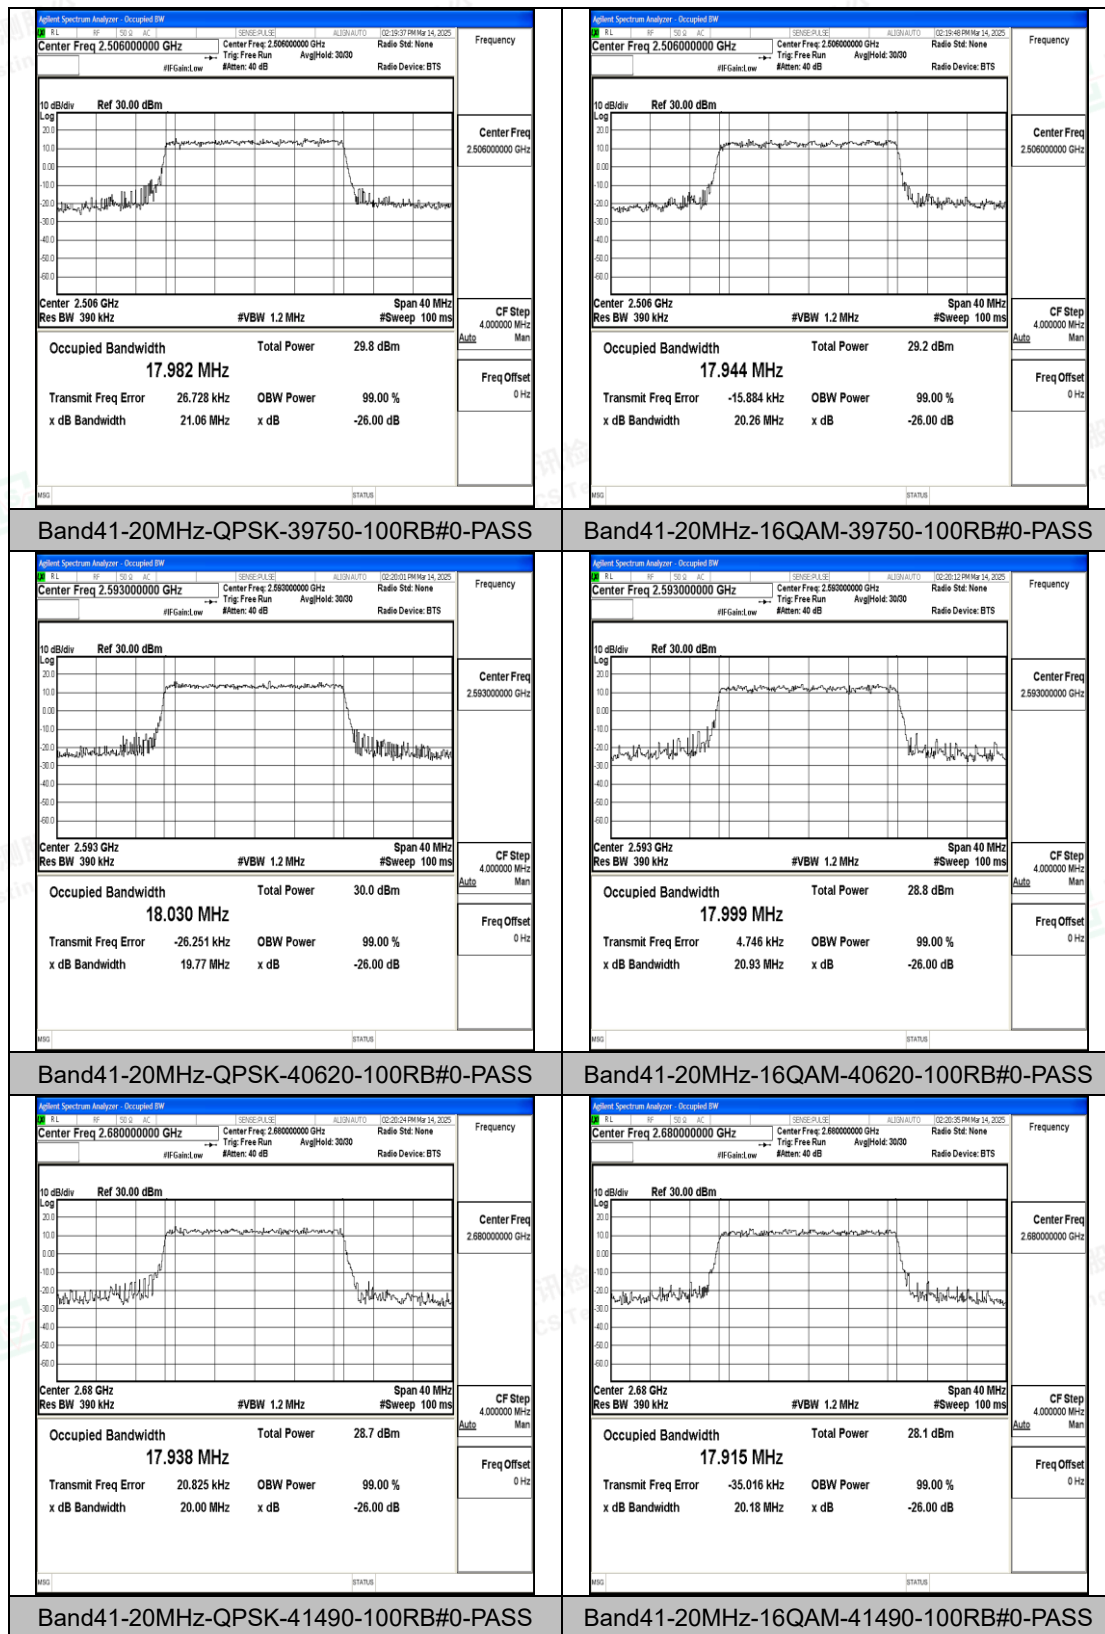

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



O.4 Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	-42.32	PASS
Band41	5MHz	16QAM	39675	25RB#0	-41.95	PASS
Band41	5MHz	QPSK	41565	25RB#0	-39.57	PASS
Band41	5MHz	16QAM	41565	25RB#0	-39.65	PASS
Band41	10MHz	QPSK	39700	50RB#0	-35.92	PASS
Band41	10MHz	16QAM	39700	50RB#0	-36.26	PASS
Band41	10MHz	QPSK	41540	50RB#0	-35.89	PASS
Band41	10MHz	16QAM	41540	50RB#0	-35.44	PASS
Band41	15MHz	QPSK	39725	75RB#0	-36.02	PASS
Band41	15MHz	16QAM	39725	75RB#0	-36.75	PASS
Band41	20MHz	QPSK	39750	100RB#0	-33.03	PASS
Band41	20MHz	16QAM	39750	100RB#0	-32.53	PASS
Band41	15MHz	QPSK	41515	75RB#0	-34.68	PASS
Band41	15MHz	16QAM	41515	75RB#0	-34.49	PASS
Band41	20MHz	QPSK	41490	100RB#0	-33.47	PASS
Band41	20MHz	16QAM	41490	100RB#0	-33.58	PASS





Test Graphs

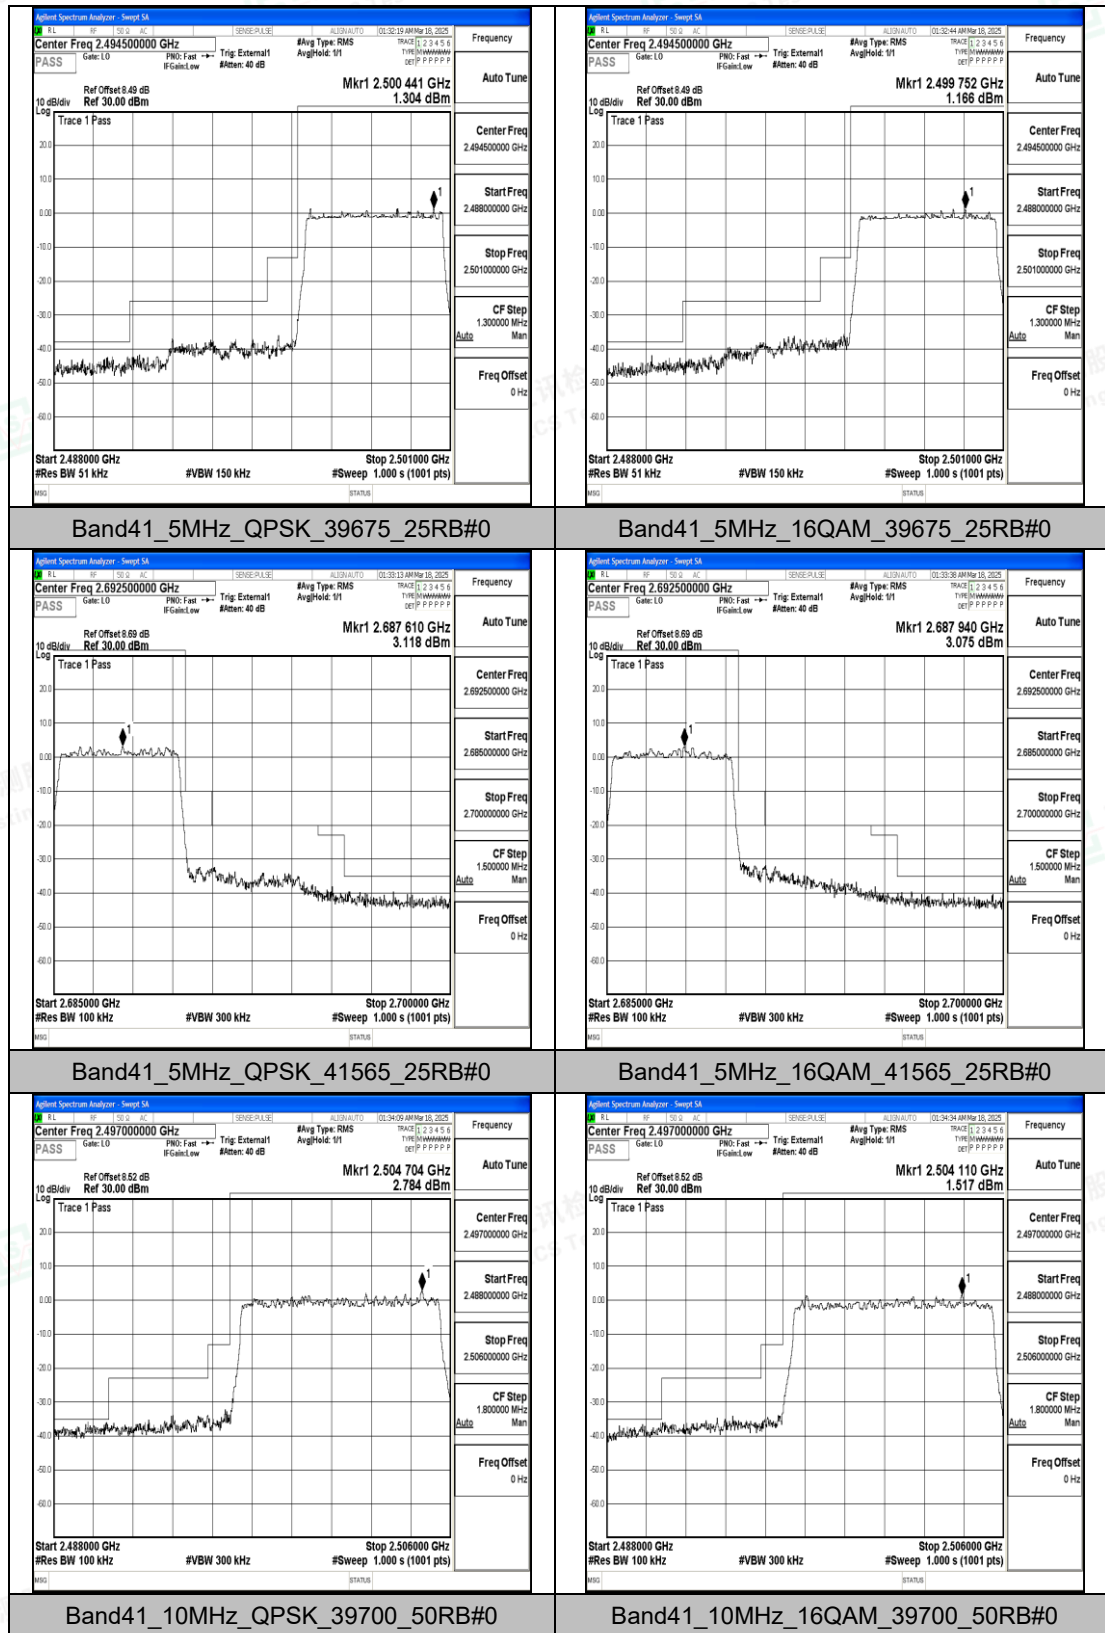



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

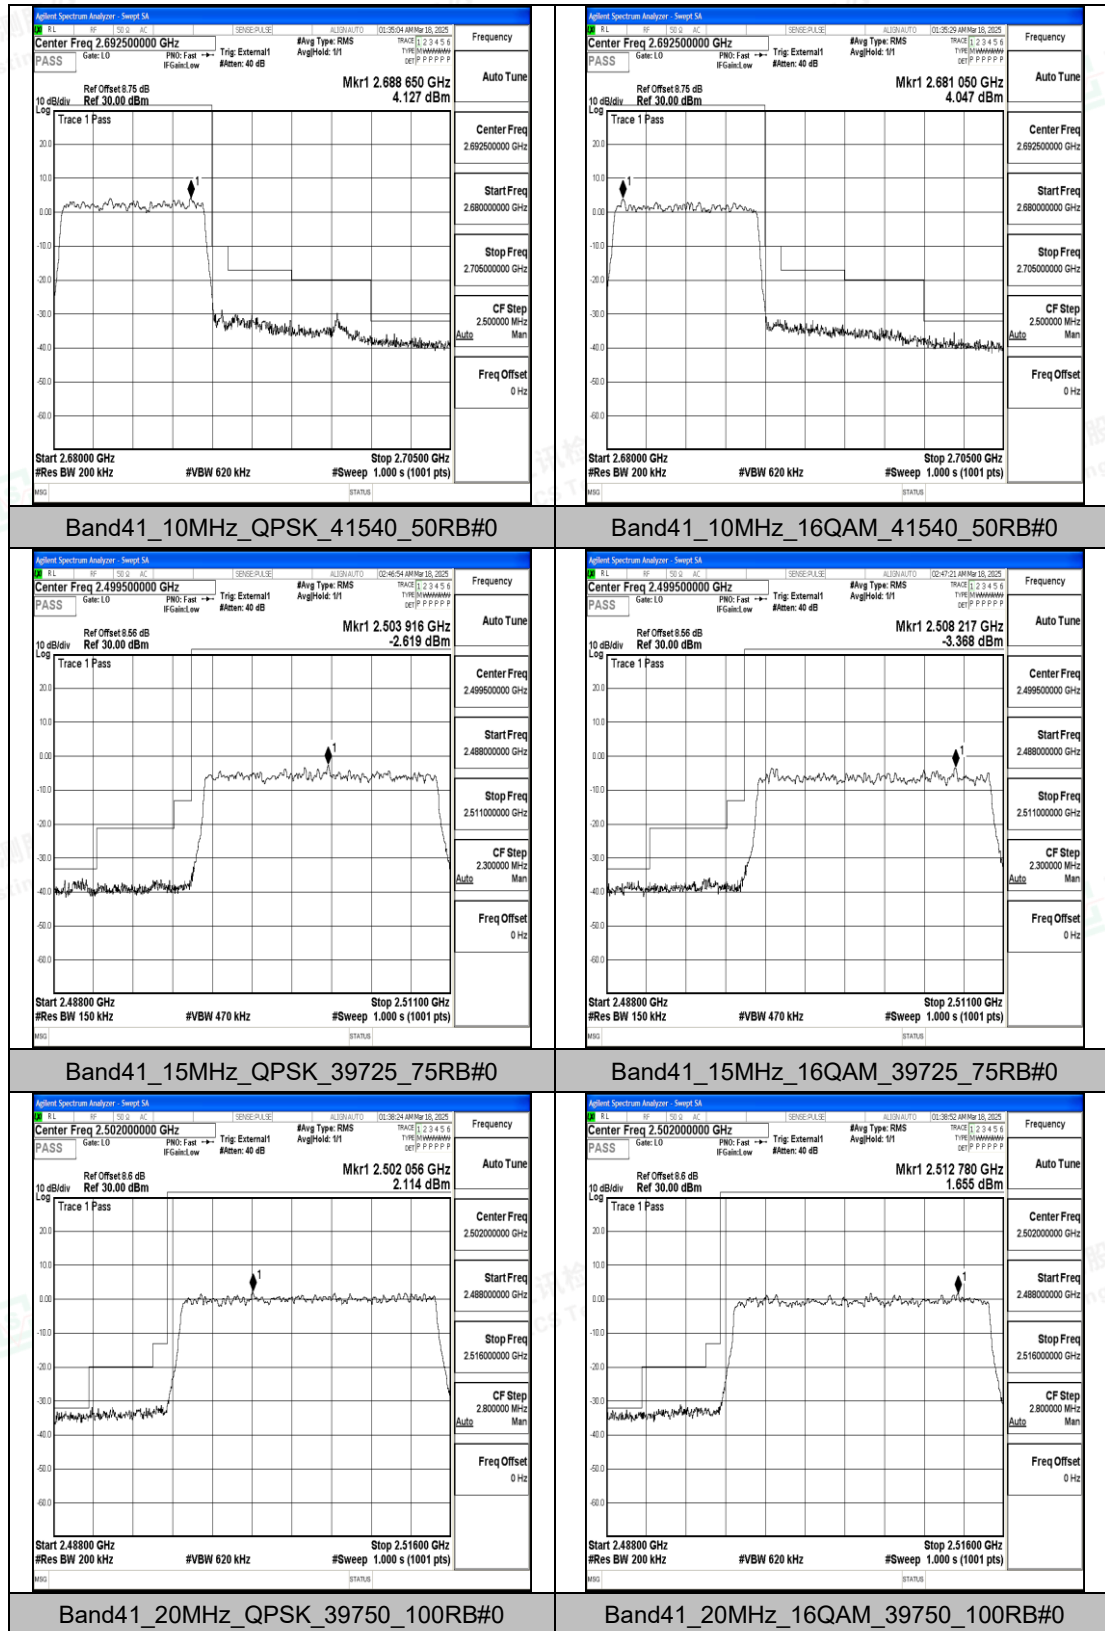

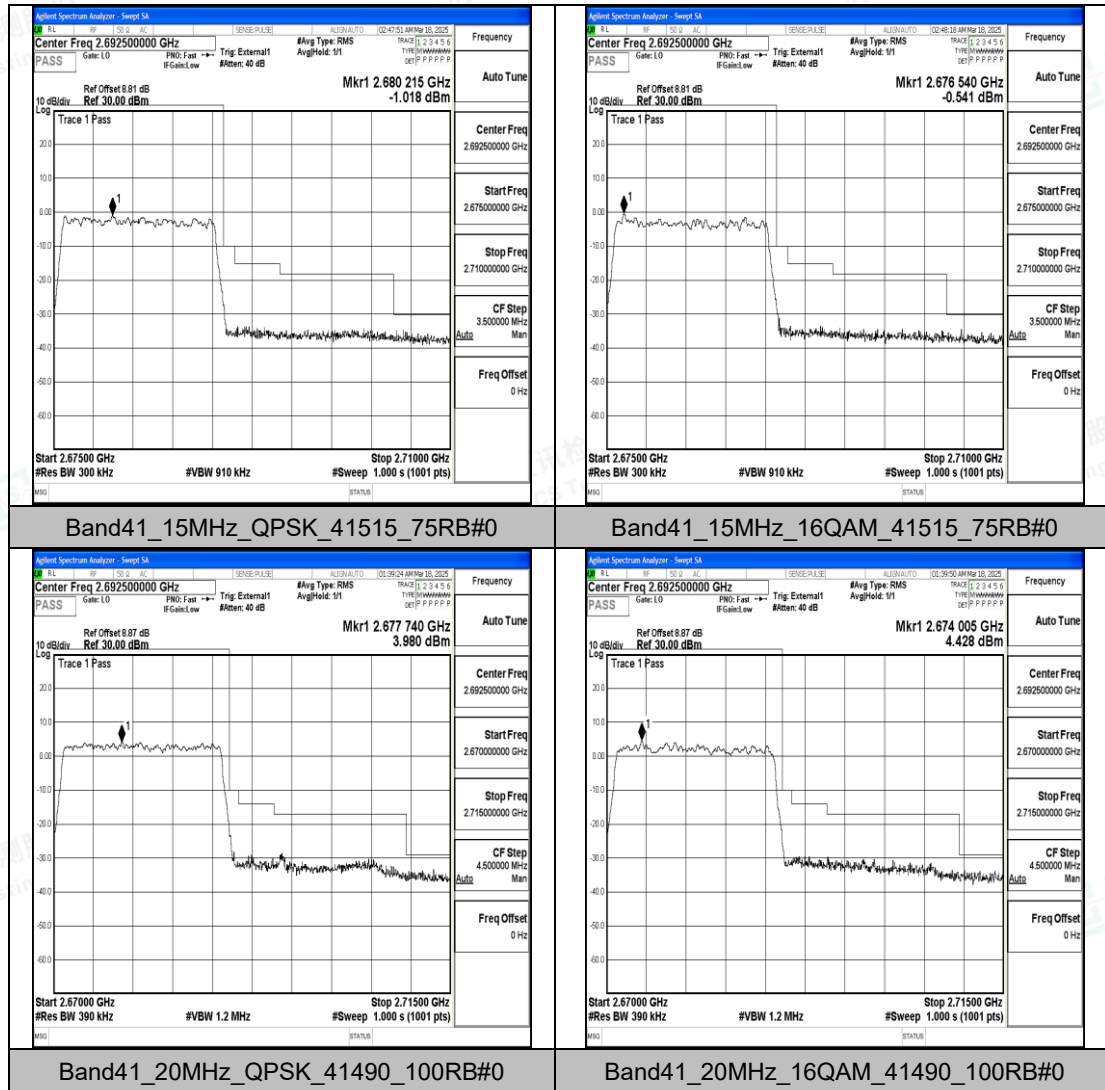

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



O.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-65.14	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-53.82	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-53.22	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-34.19	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-35.89	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.05	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-54.37	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-52.88	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-34.87	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.48	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-66.06	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-52.15	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-52.98	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-34.36	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-36.85	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-67.10	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-53.36	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-52.71	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-34.37	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-36.11	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-64.58	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-55.81	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-51.99	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-34.43	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-36.46	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-65.54	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-54.93	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-53.20	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.82	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.51	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-66.54	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-52.28	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-51.94	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-34.43	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.79	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-64.66	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-55.32	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-53.08	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-34.26	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-36.14	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-64.76	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-54.25	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-53.13	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-34.54	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.38	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-65.65	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-55.84	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-52.97	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-34.40	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-36.14	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-65.56	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-51.99	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-52.77	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-34.23	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.79	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-65.67	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-53.76	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-52.89	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-34.21	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.37	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-66.39	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-54.61	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-52.70	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-34.93	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-36.10	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-65.35	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-56.82	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-51.87	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-34.54	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-36.32	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-64.30	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-57.55	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-52.41	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-34.55	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-36.64	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-64.96	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-53.77	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-53.16	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.34	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-36.05	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-66.19	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-54.88	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-52.36	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-34.06	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.56	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-65.59	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-57.08	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-52.63	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-34.60	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.93	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-65.38	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-54.70	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-53.07	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-34.25	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.73	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-66.97	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-54.40	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-53.04	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-34.96	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-36.50	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-64.85	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-55.35	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-53.08	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-34.31	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-36.34	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-65.76	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-50.65	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-52.20	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-34.79	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-36.08	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-64.62	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-53.11	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-52.74	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-34.62	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-36.28	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-65.39	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-56.07	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-52.87	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-34.54	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-36.17	PASS


Test Graphs

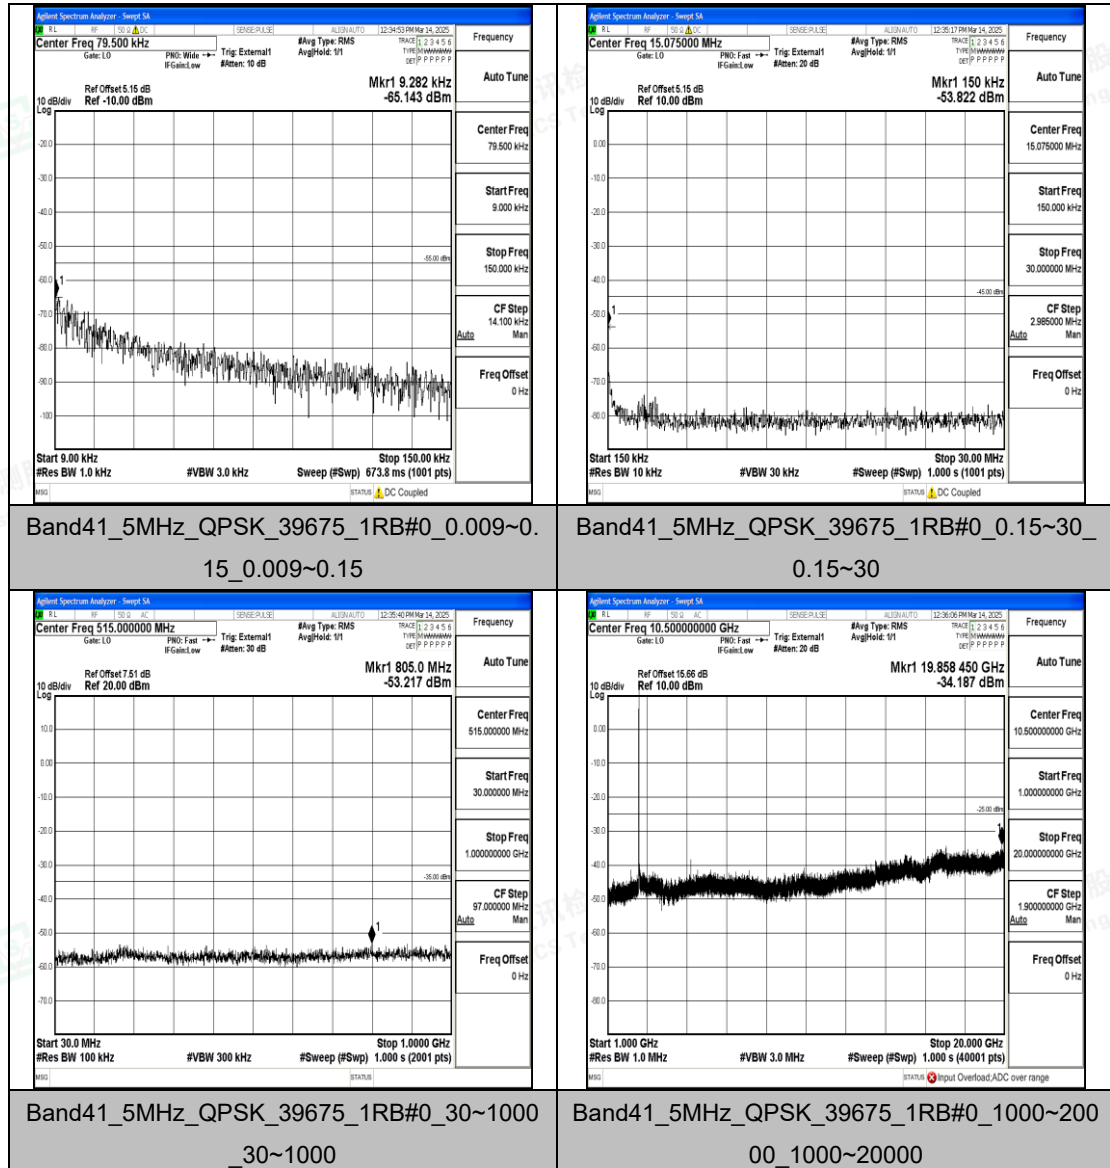

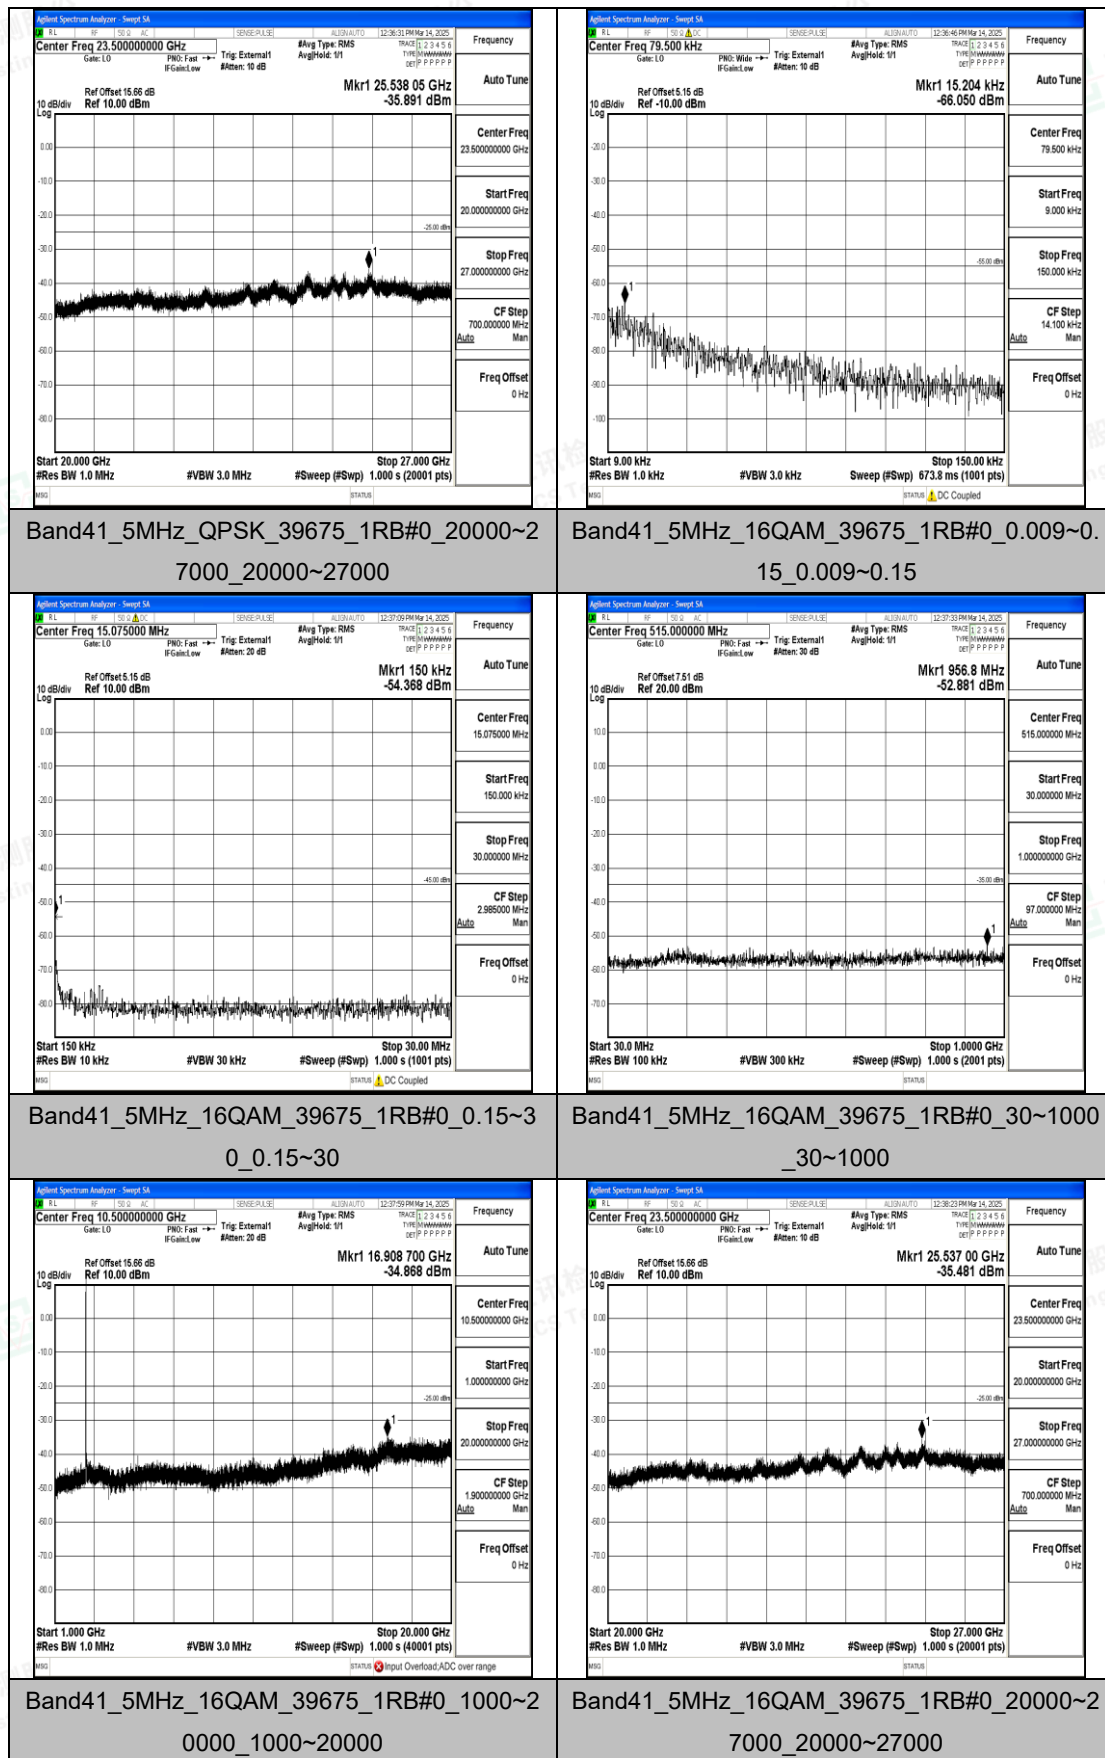


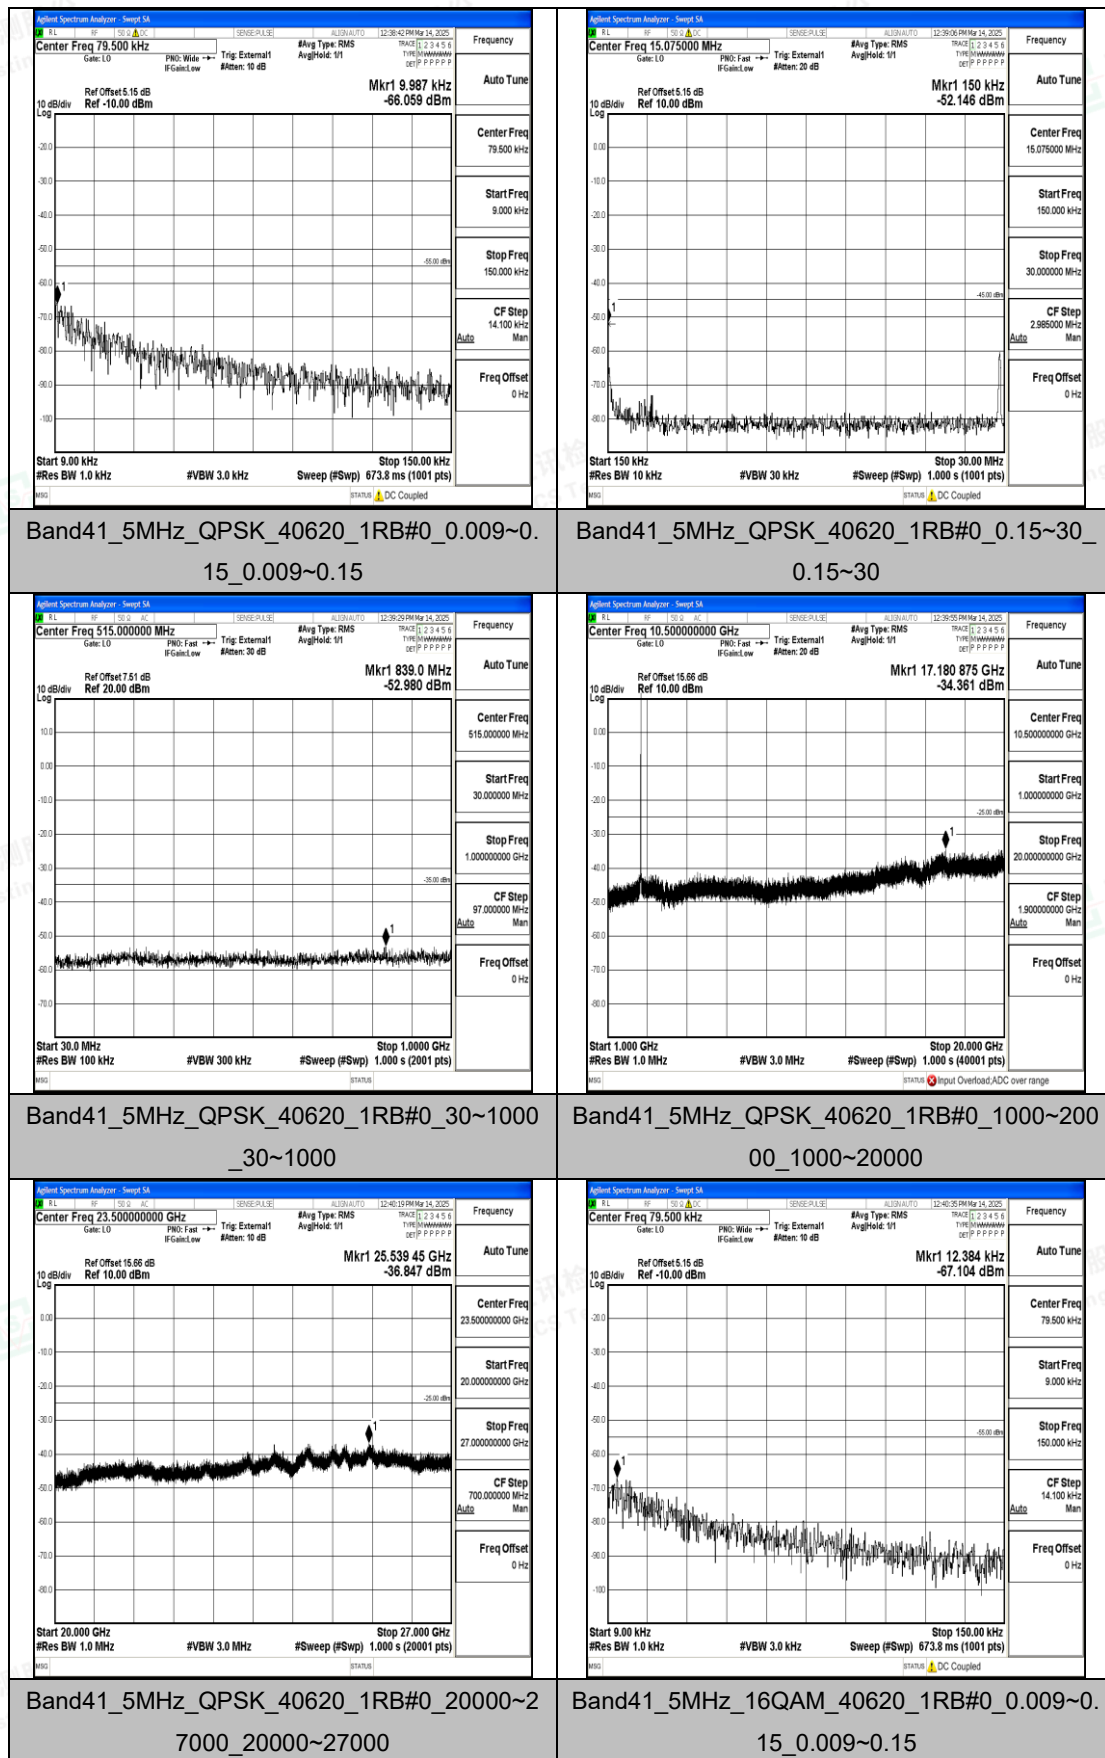


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

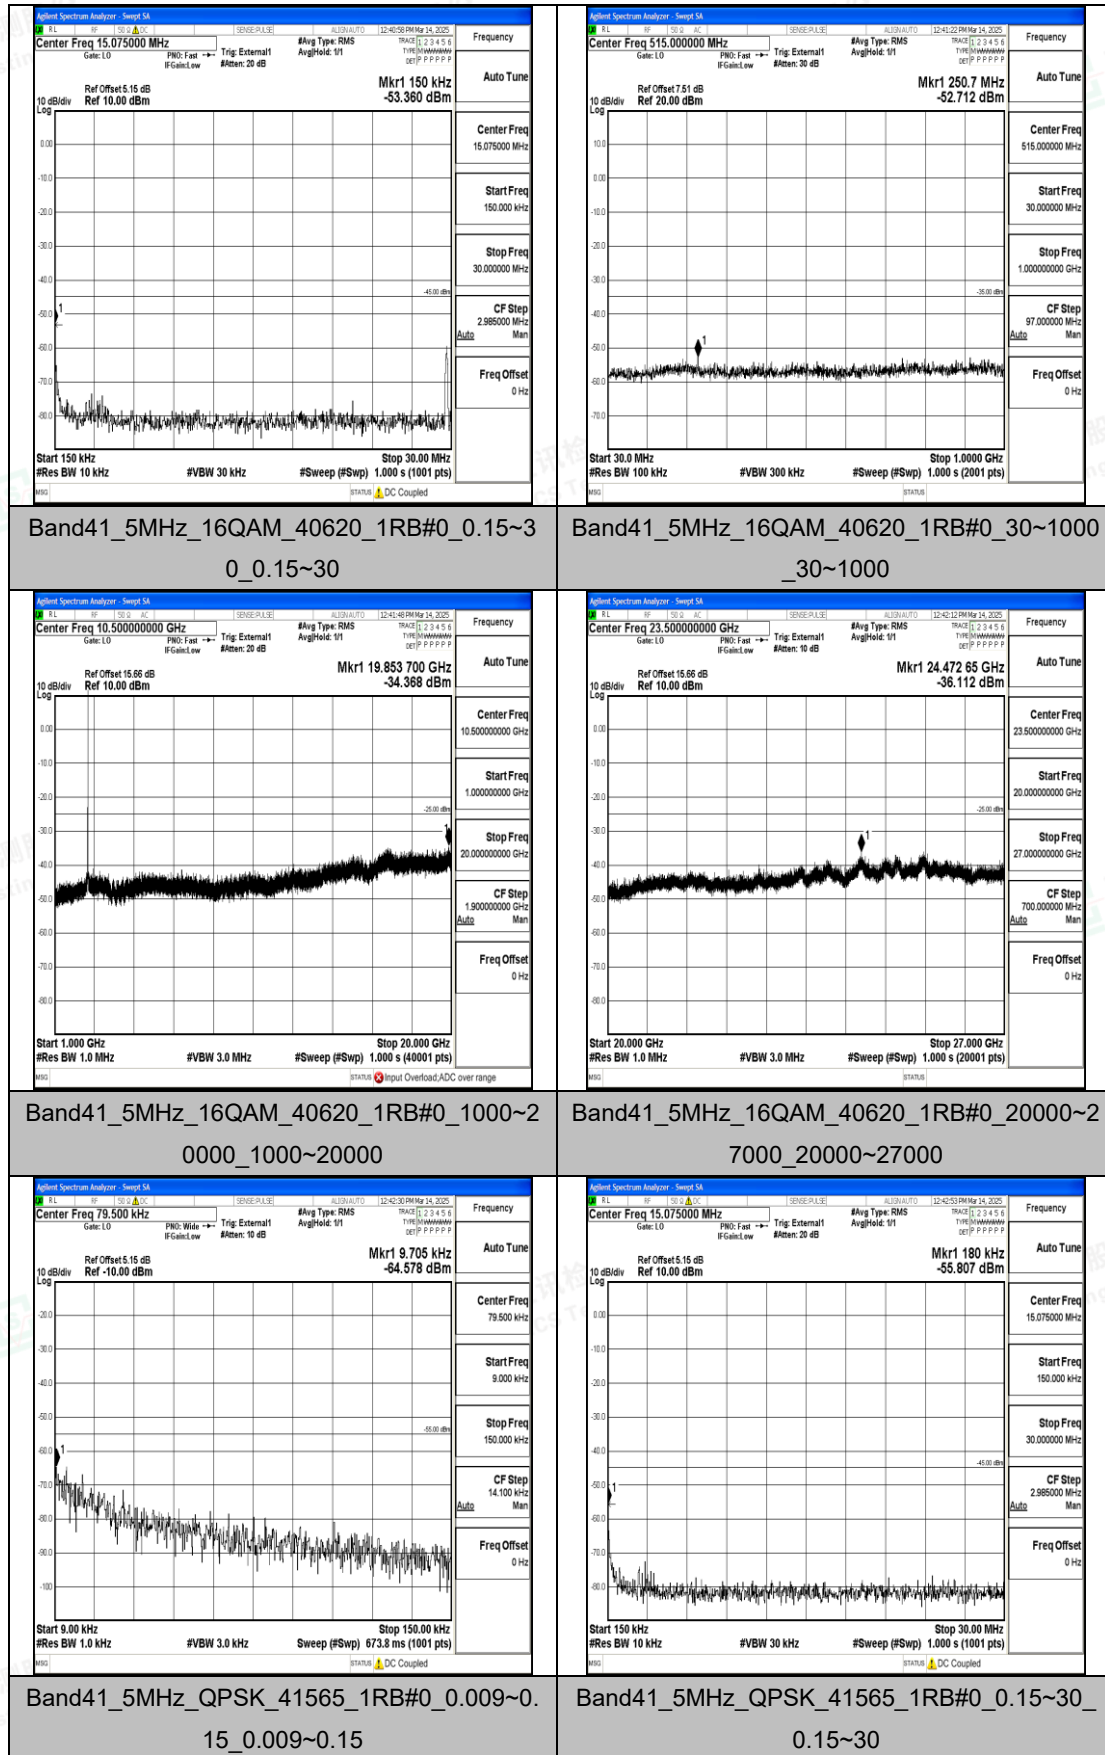


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

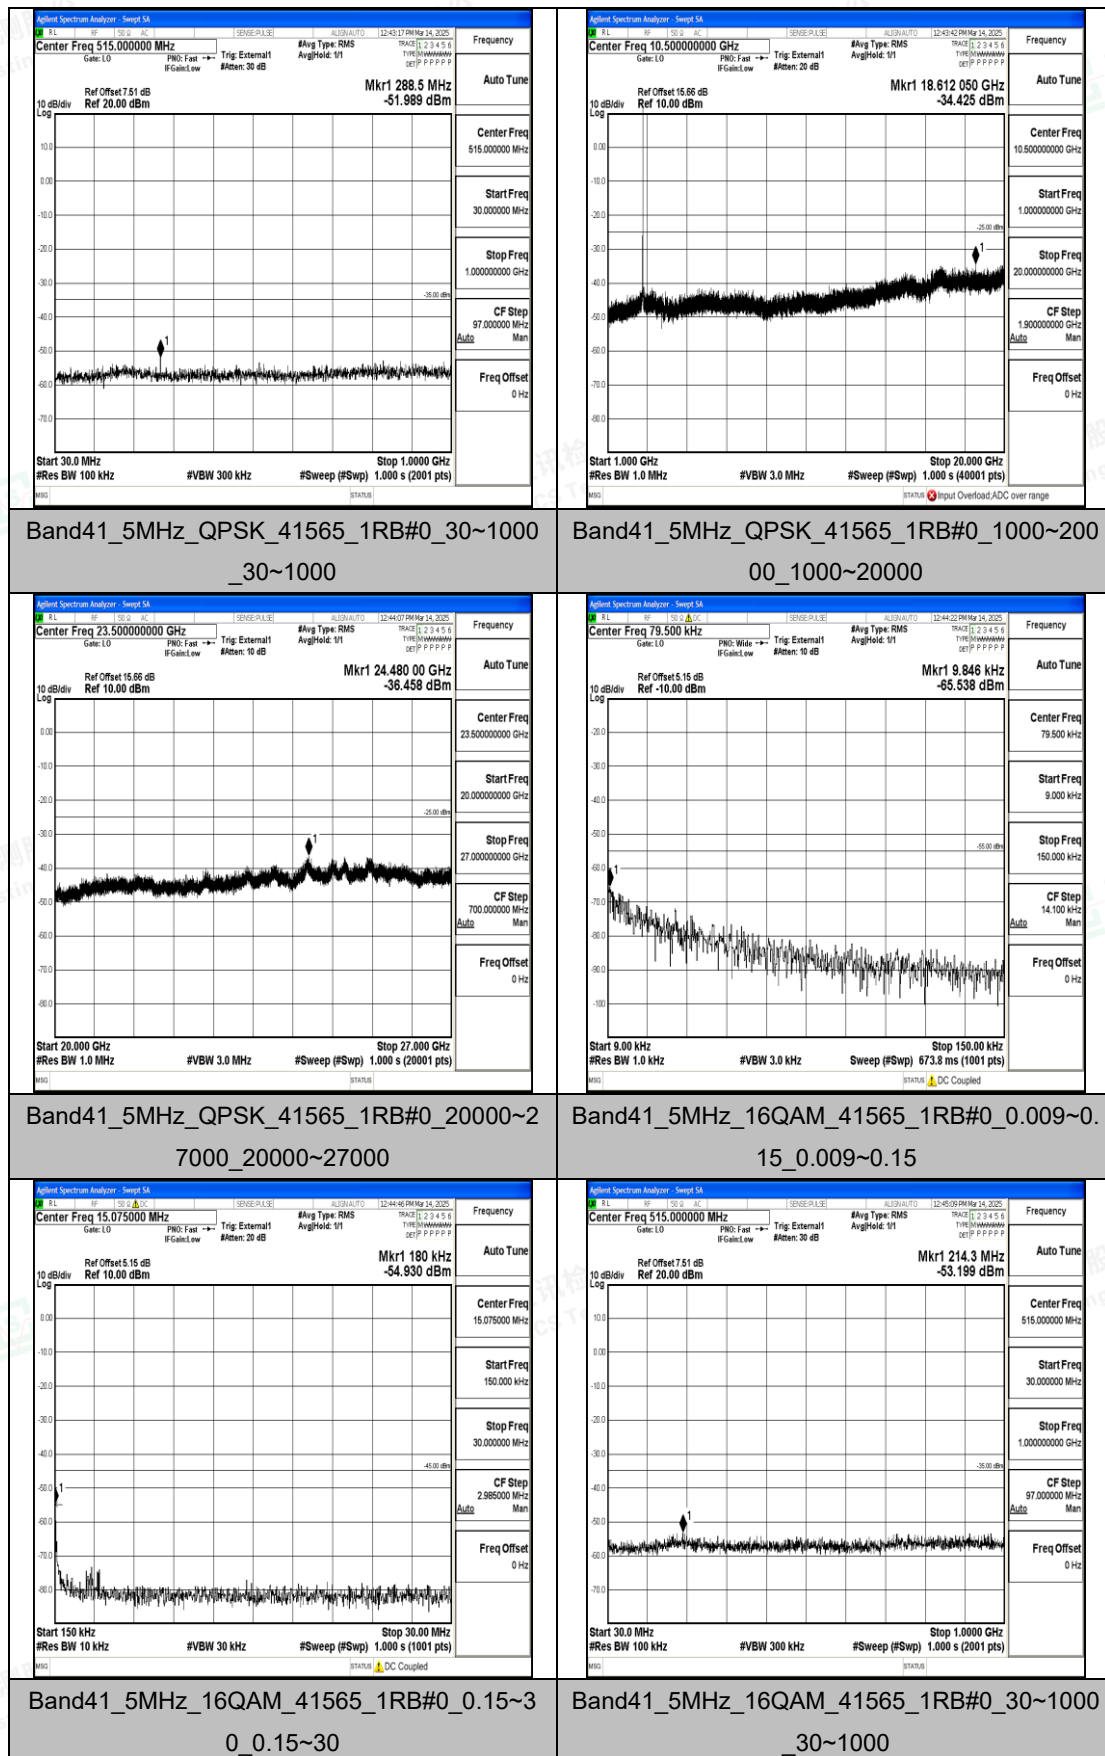

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

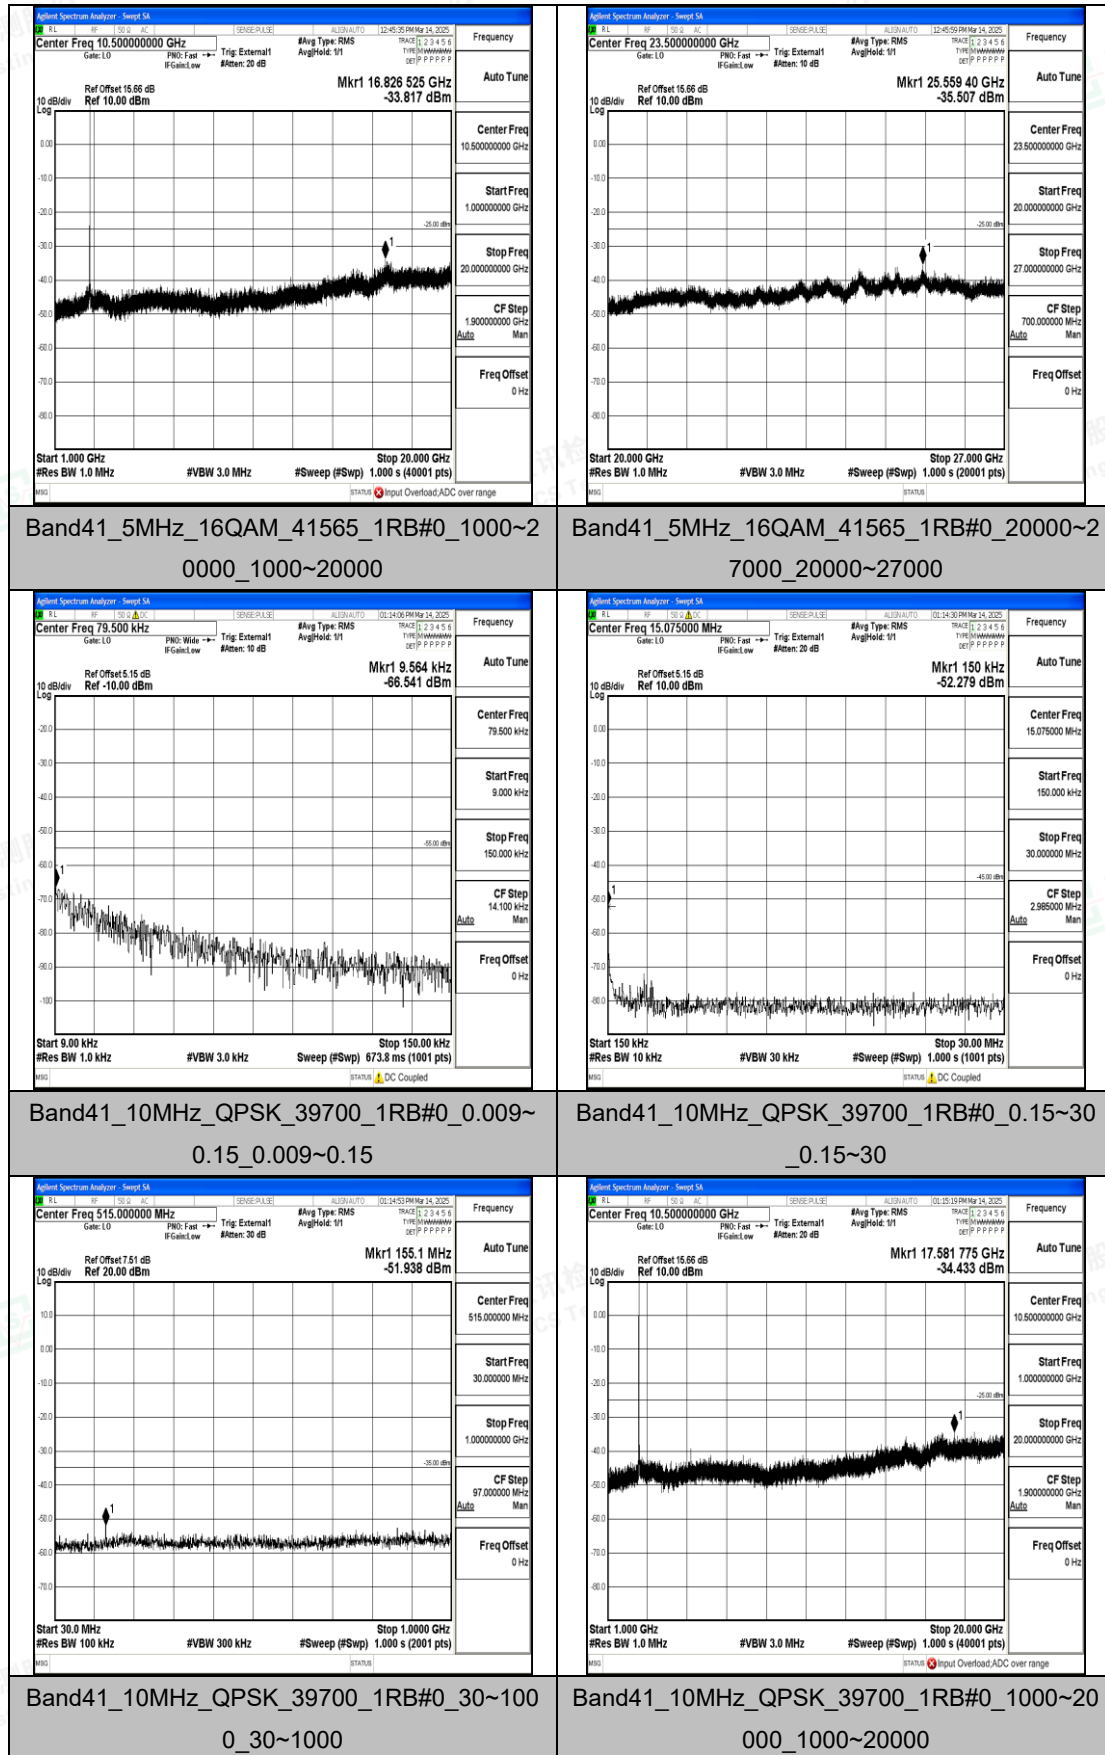

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

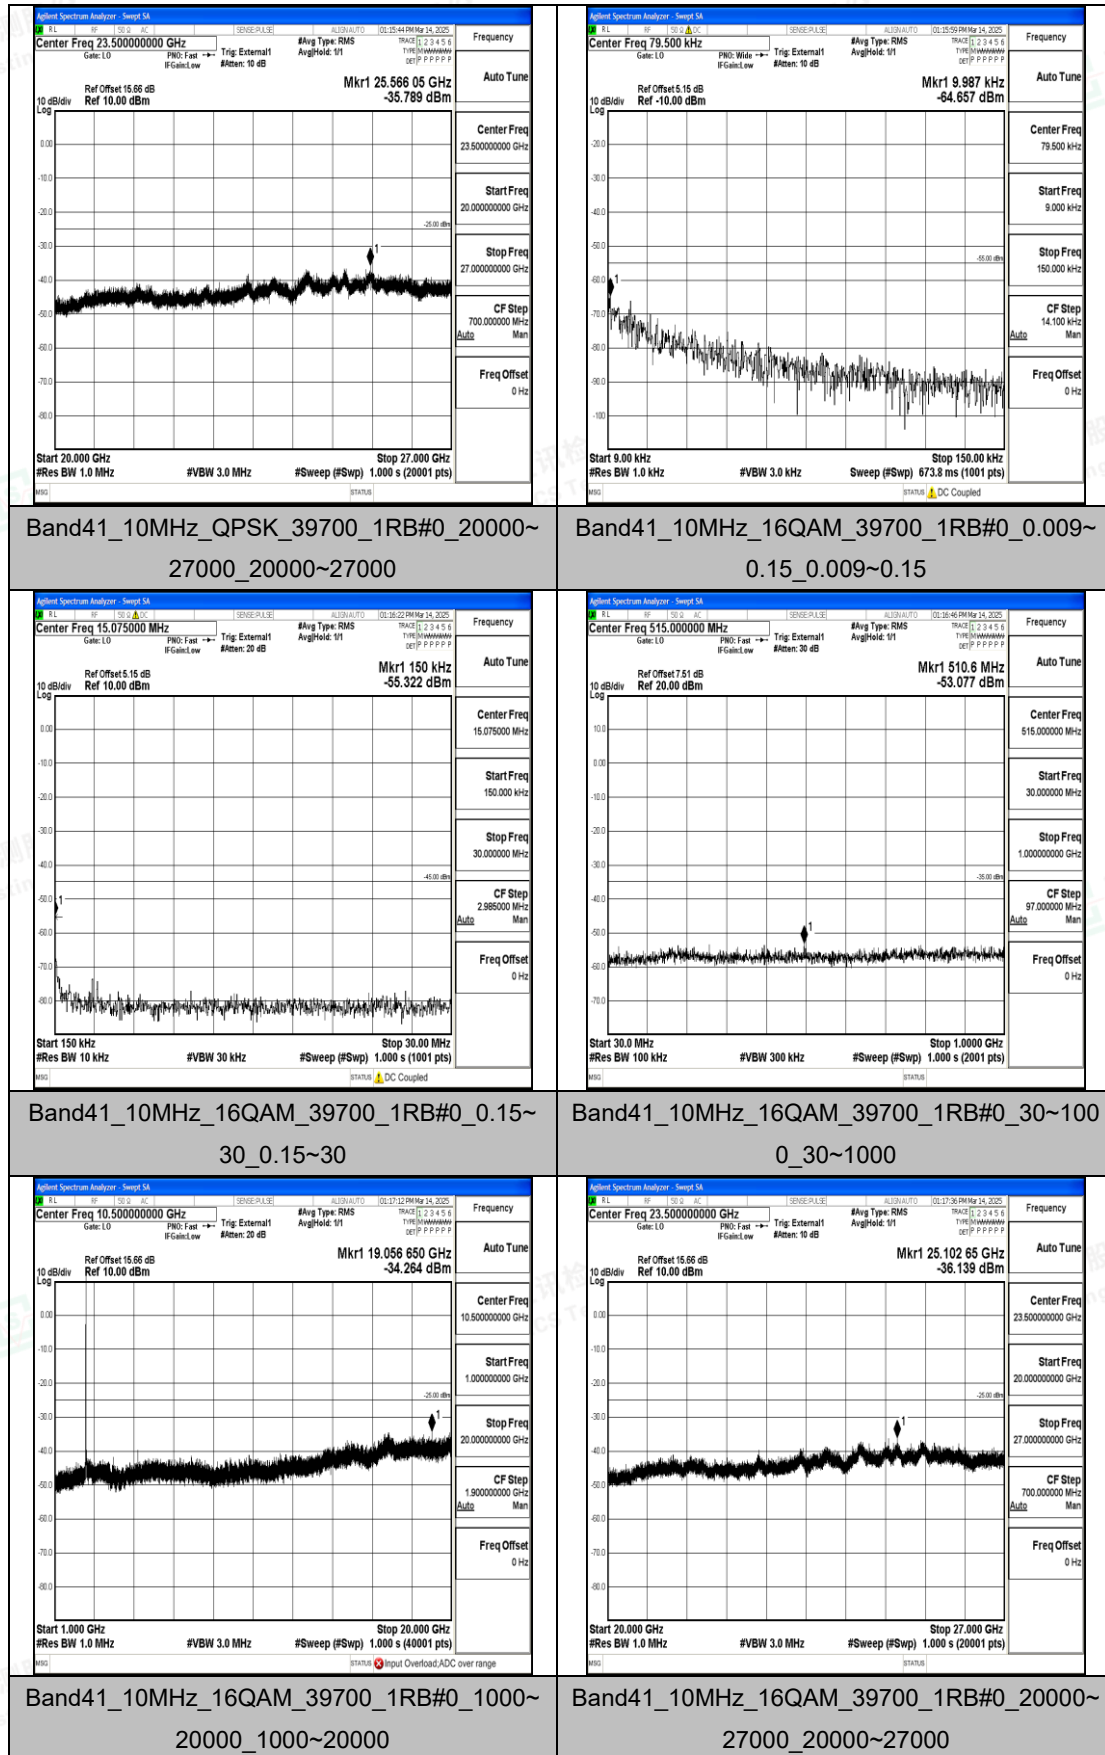

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity