



Report

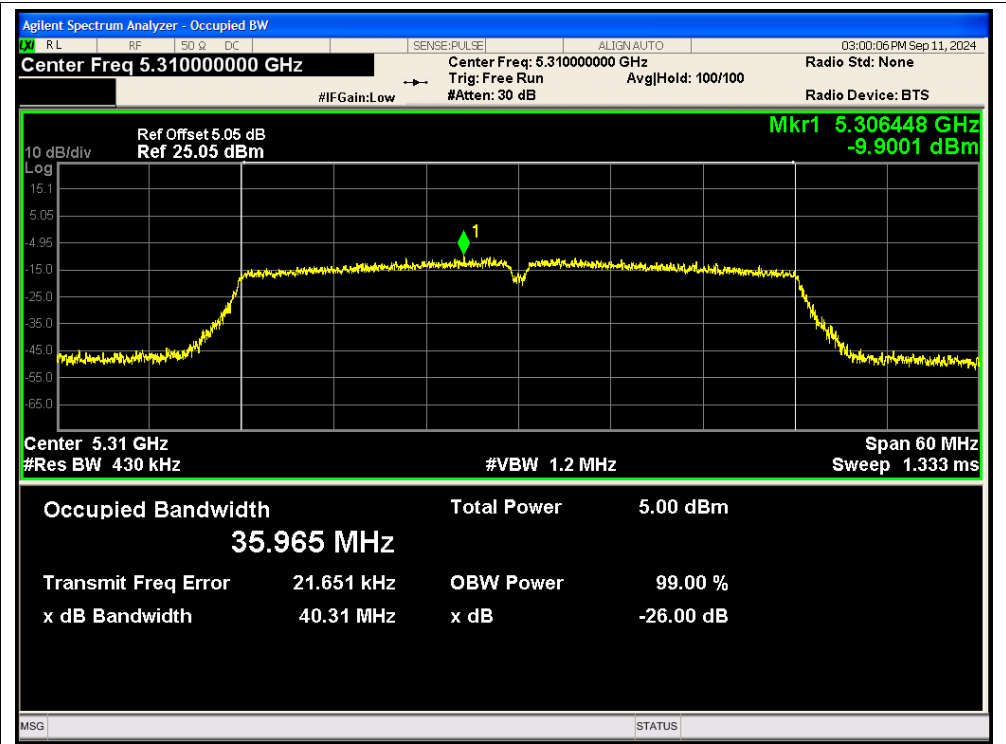


OBW NVNT n40 5310MHz Ant2

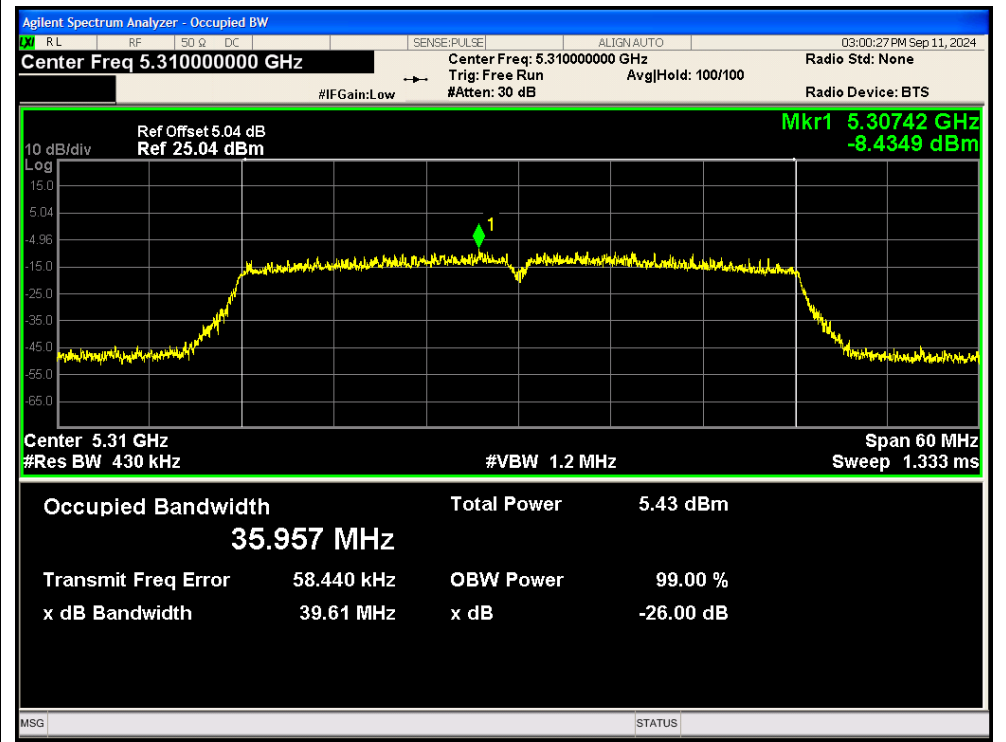


OBW NVNT n40 5510MHz Ant1

Report

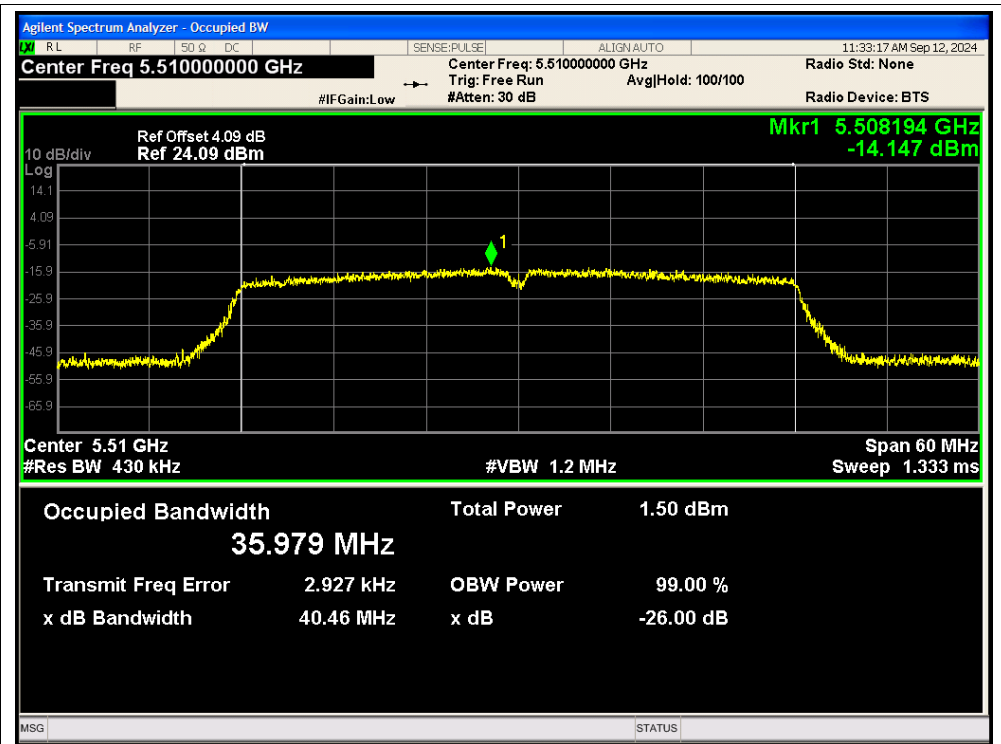


OBW NVNT n40 5510MHz Ant2

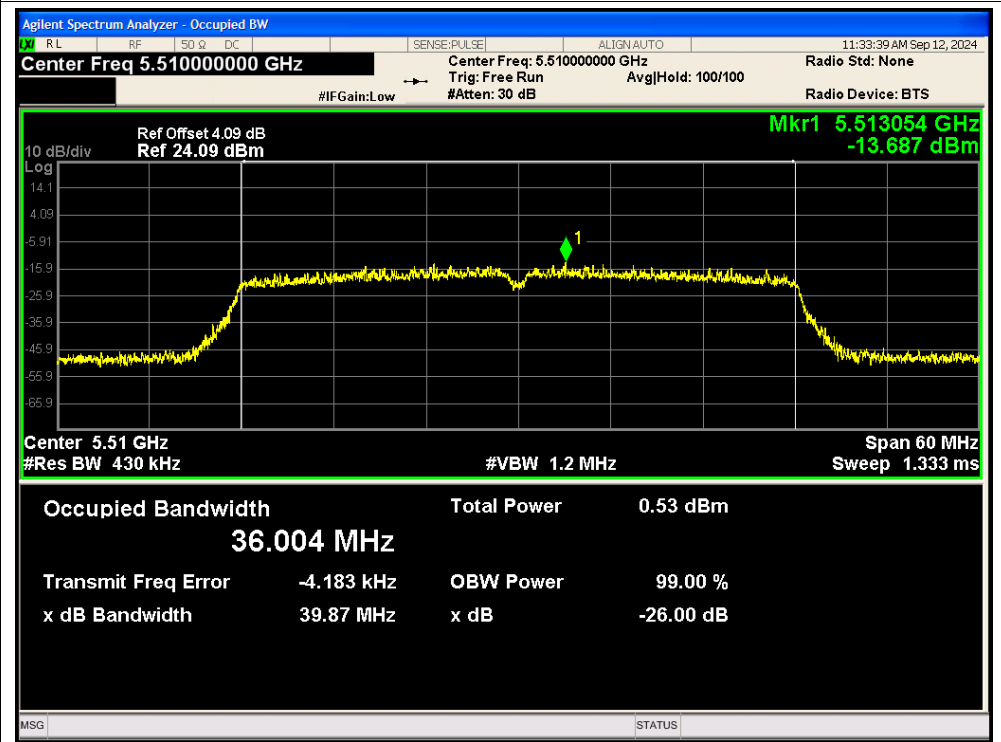


OBW NVNT n40 5600MHz Ant1

Report

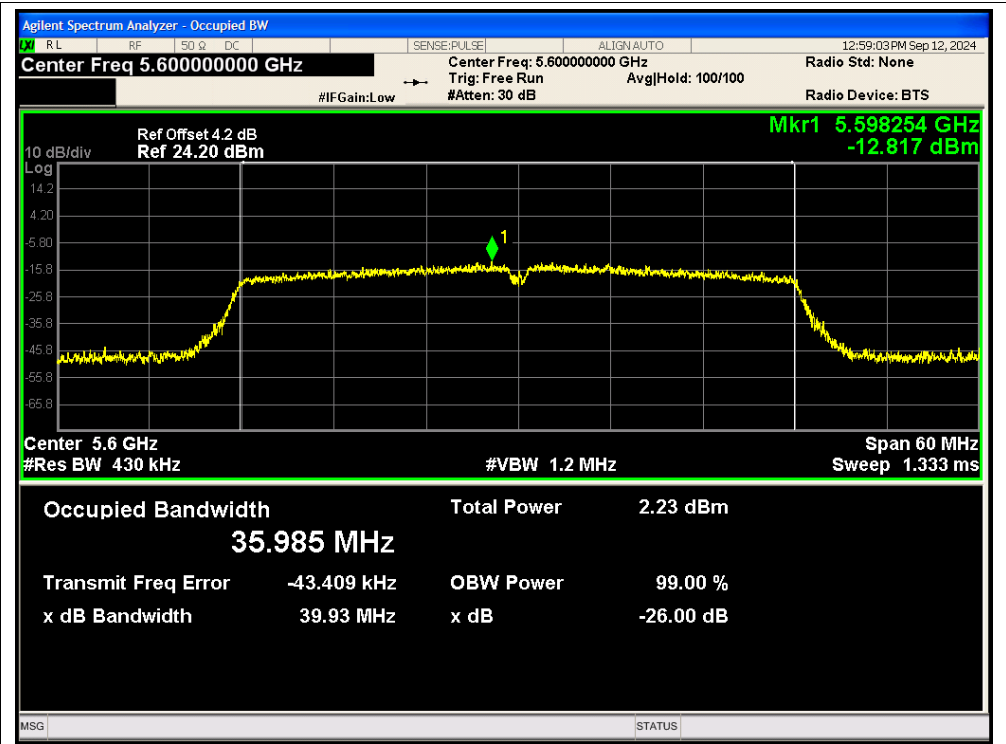


OBW NVNT n40 5600MHz Ant2

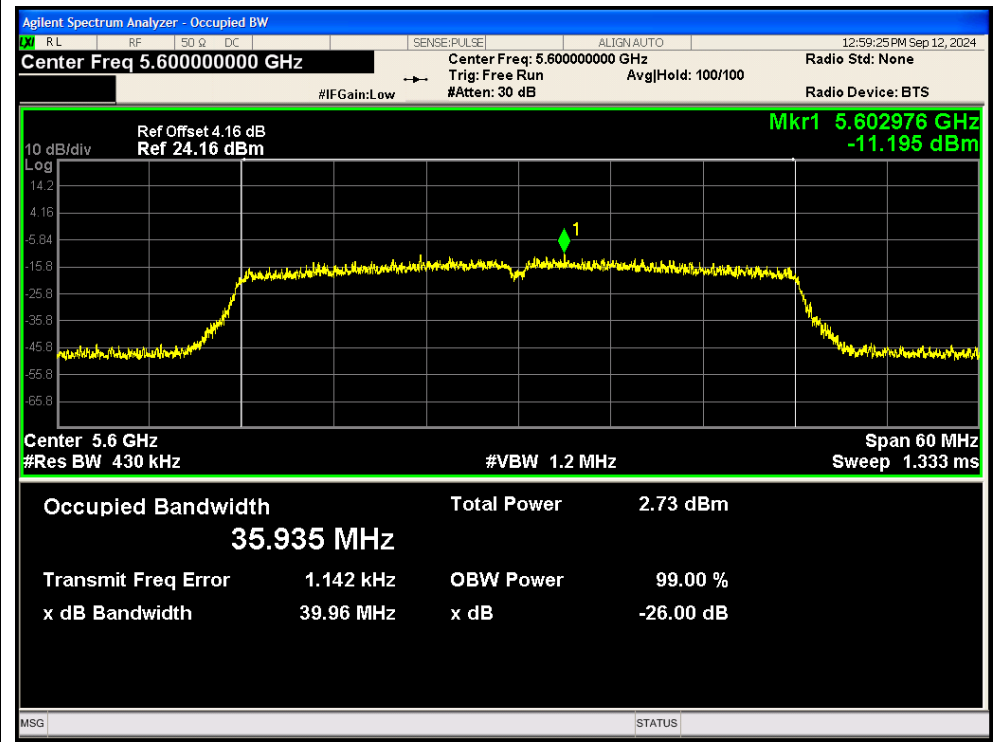


OBW NVNT n40 5690MHz Ant1

Report

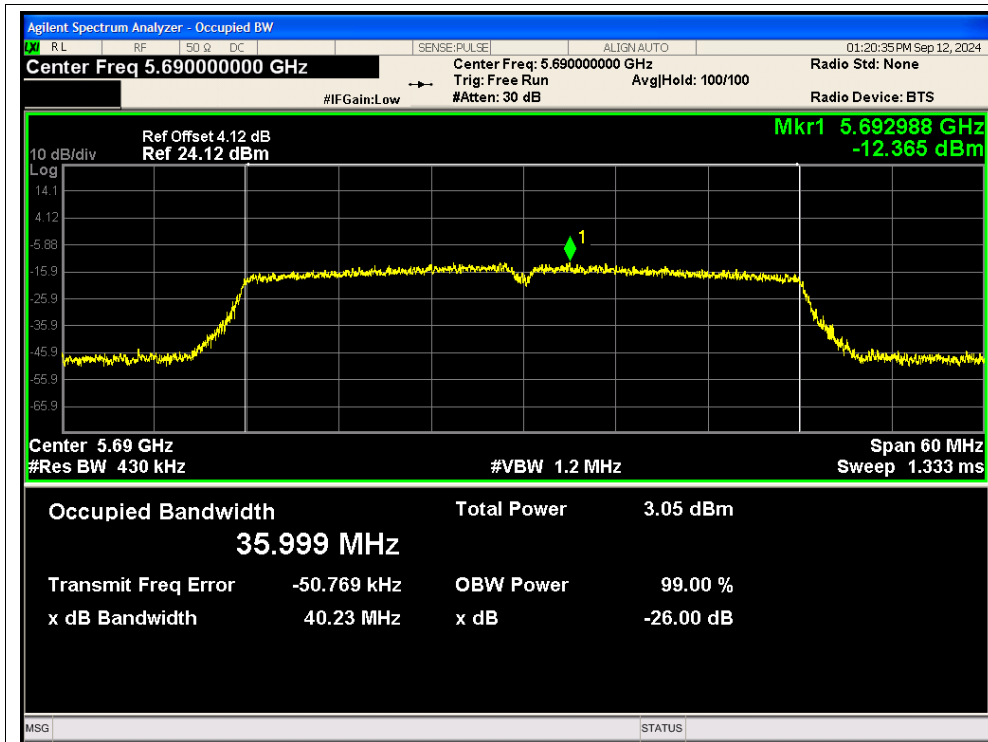


OBW NVNT n40 5690MHz Ant2

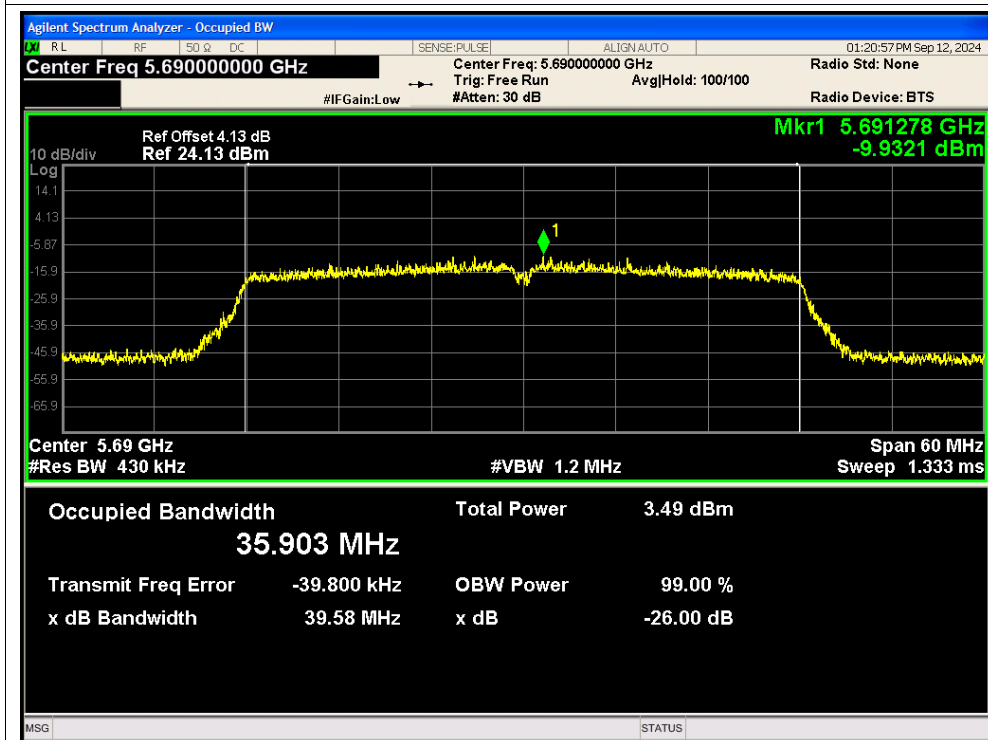


OBW NVNT n40 5755MHz Ant1

Report

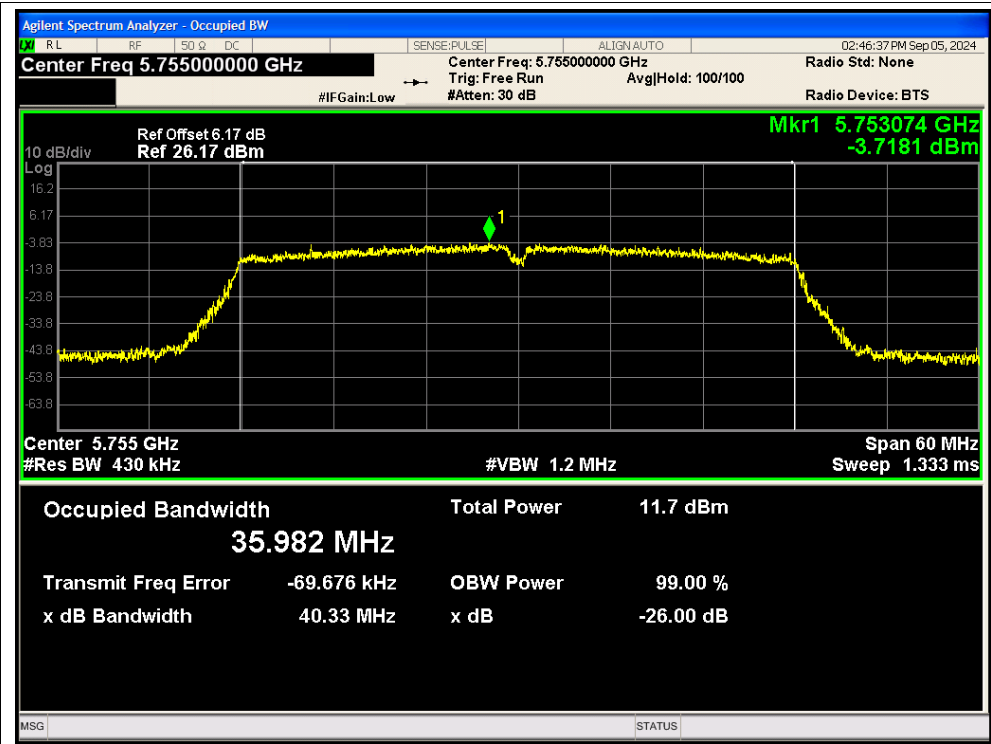


OBW NVNT n40 5755MHz Ant2

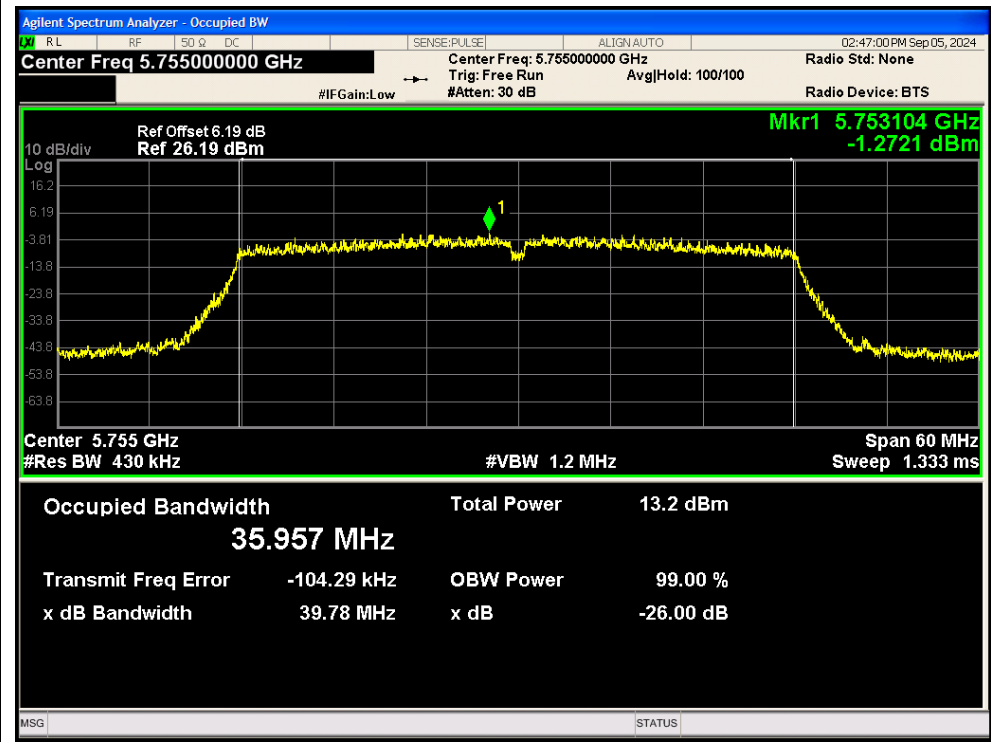


OBW NVNT n40 5785MHz Ant1

Report

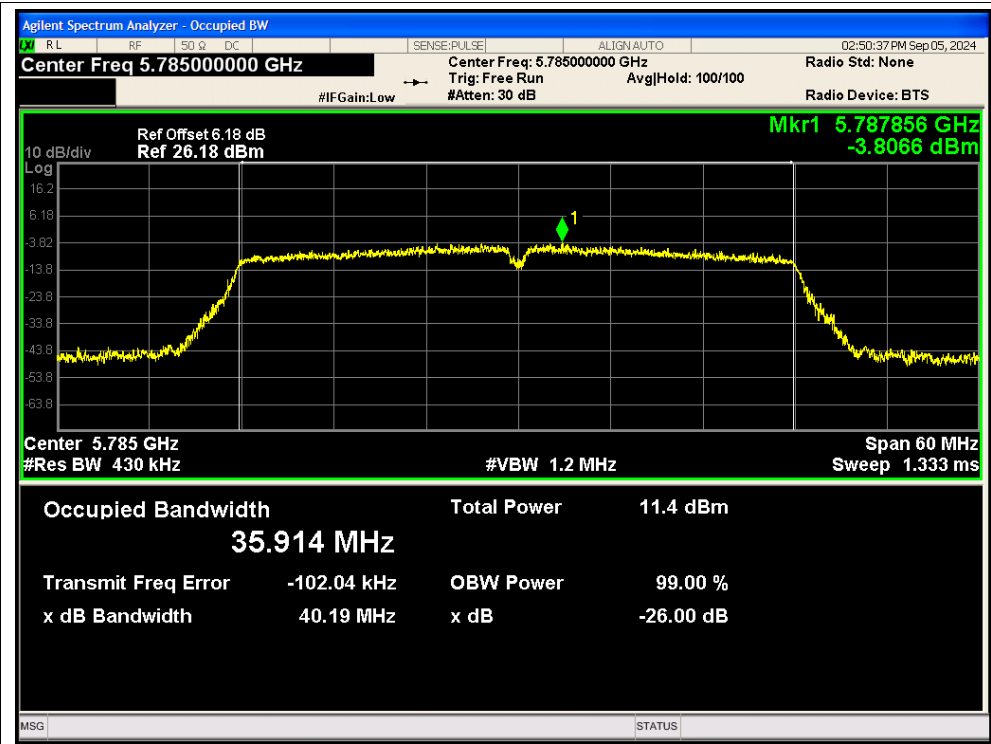


OBW NVNT n40 5785MHz Ant2

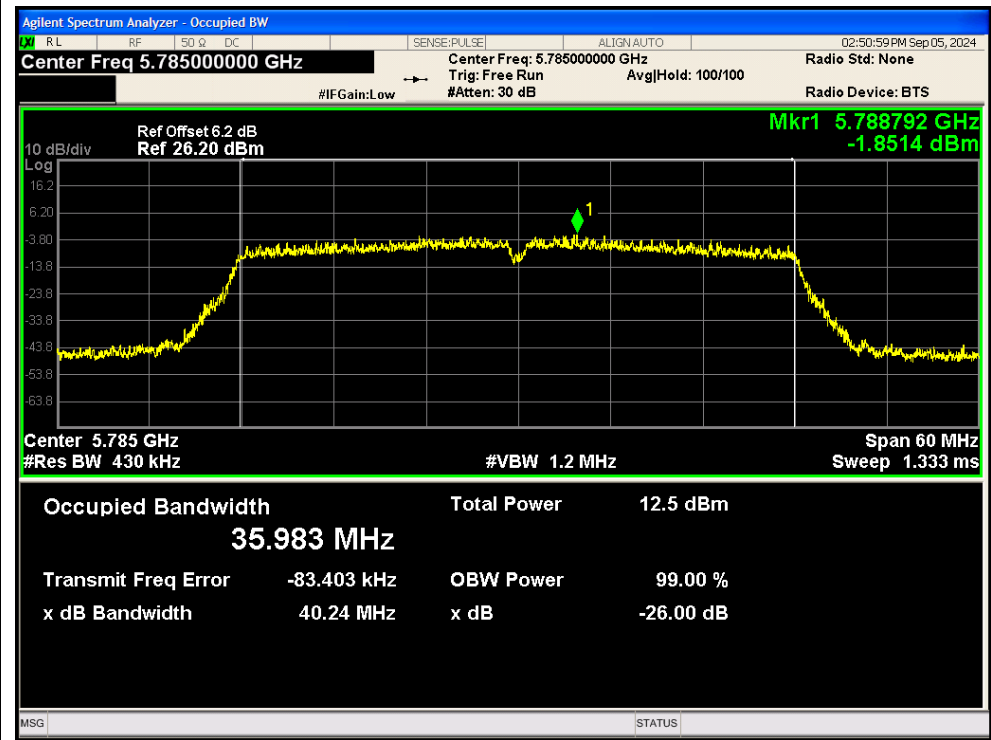


OBW NVNT n40 5815MHz Ant1

Report

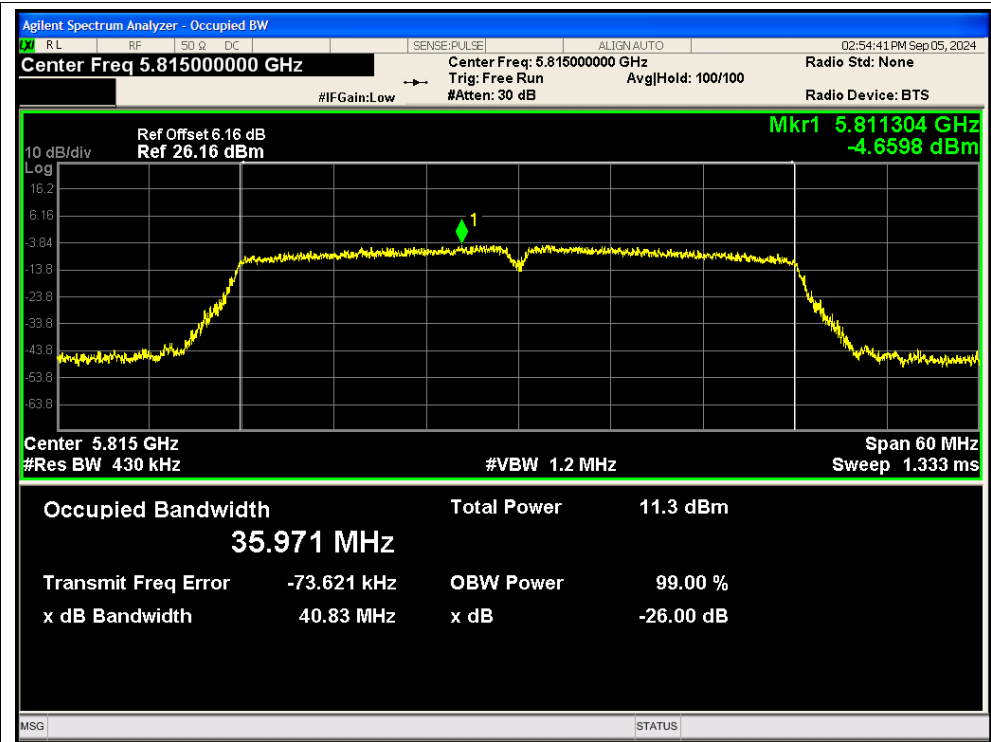

OBW NVNT n40 5815MHz Ant2

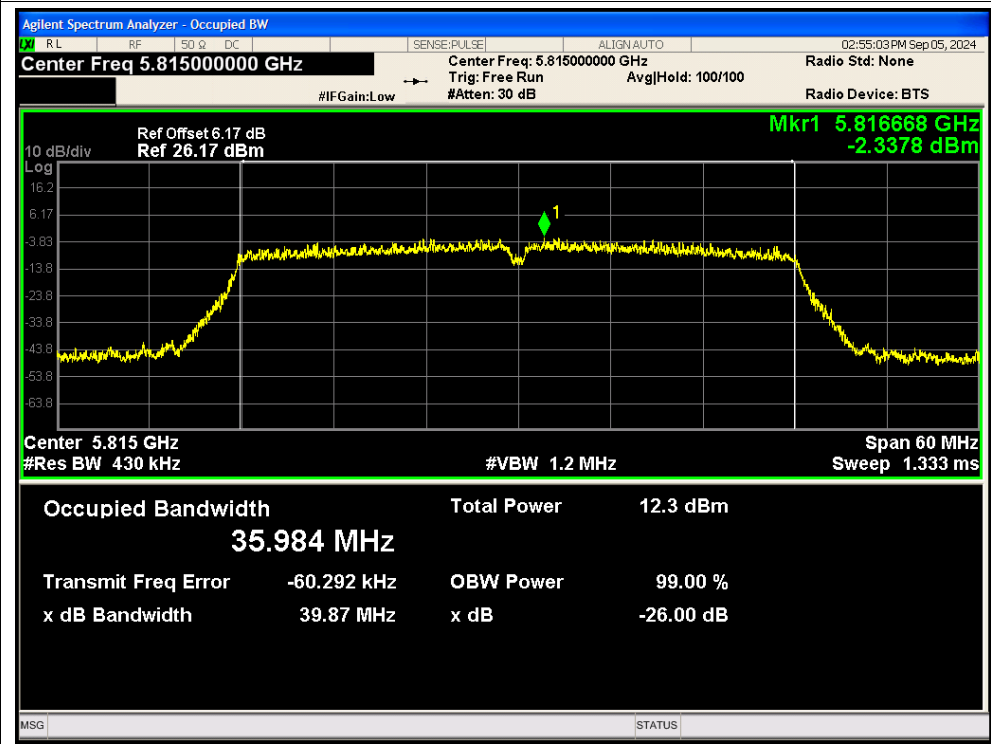

Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	-4.33	0.18	-4.15	4.2	Pass
NVNT	a	5210	Ant1	-4.56	0.18	-4.38	4.2	Pass
NVNT	a	5240	Ant1	-4.44	0.15	-4.29	4.2	Pass
NVNT	a	5260	Ant1	-5.28	0.15	-5.13	-1.85	Pass
NVNT	a	5290	Ant1	-4.92	0.18	-4.74	-1.85	Pass
NVNT	a	5320	Ant1	-4.83	0.18	-4.65	-1.85	Pass
NVNT	a	5500	Ant1	-5.27	0.18	-5.09	-2.26	Pass
NVNT	a	5600	Ant1	-4.77	0.18	-4.59	-2.26	Pass
NVNT	a	5700	Ant1	-3.74	0.18	-3.56	-2.26	Pass
NVNT	a	5180	Ant2	-4.04	0.15	-3.89	4.48	Pass
NVNT	a	5210	Ant2	-3.91	0.18	-3.73	4.48	Pass
NVNT	a	5240	Ant2	-3.47	0.15	-3.32	4.48	Pass
NVNT	a	5260	Ant2	-4.44	0.18	-4.26	-1.07	Pass
NVNT	a	5290	Ant2	-3.85	0.18	-3.67	-1.07	Pass
NVNT	a	5320	Ant2	-5.49	0.18	-5.31	-1.07	Pass
NVNT	a	5500	Ant2	-4.59	0.18	-4.41	-1.46	Pass
NVNT	a	5600	Ant2	-4.89	0.18	-4.71	-1.46	Pass
NVNT	a	5700	Ant2	-3.01	0.15	-2.86	-1.46	Pass
NVNT	a	5745	Ant1	-3.21	0.18	-3.03	16.85	Pass
NVNT	a	5785	Ant1	-3.46	0.18	-3.28	16.85	Pass
NVNT	a	5825	Ant1	-2.63	0.15	-2.48	16.85	Pass
NVNT	a	5745	Ant2	-2.66	0.15	-2.51	17.34	Pass
NVNT	a	5785	Ant2	-3.45	0.15	-3.3	17.34	Pass
NVNT	a	5825	Ant2	-3.36	0.18	-3.18	17.34	Pass
NVNT	ac20	5180	Ant1	-8.8	0.37	-8.43	1.19	Pass
NVNT	ac20	5180	Ant2	-7.91	0.37	-7.54	1.19	Pass
NVNT	ac20	5180	Sum	-5.32	0.37	-4.95	1.19	Pass
NVNT	ac20	5210	Ant1	-8.48	0.37	-8.11	1.19	Pass
NVNT	ac20	5210	Ant2	-8.05	0.37	-7.68	1.19	Pass
NVNT	ac20	5210	Sum	-5.25	0.37	-4.88	1.19	Pass
NVNT	ac20	5240	Ant1	-8.61	0.37	-8.24	1.19	Pass
NVNT	ac20	5240	Ant2	-7.56	0.37	-7.19	1.19	Pass
NVNT	ac20	5240	Sum	-5.04	0.37	-4.67	1.19	Pass
NVNT	ac20	5260	Ant1	-9.53	0.36	-9.17	-4.86	Pass
NVNT	ac20	5260	Ant2	-8.04	0.36	-7.68	-4.86	Pass
NVNT	ac20	5260	Sum	-5.71	0.36	-5.35	-4.86	Pass
NVNT	ac20	5290	Ant1	-9.28	0.37	-8.91	-4.86	Pass
NVNT	ac20	5290	Ant2	-7.91	0.37	-7.54	-4.86	Pass
NVNT	ac20	5290	Sum	-5.53	0.37	-5.16	-4.86	Pass
NVNT	ac20	5320	Ant1	-9.16	0.3	-8.86	-4.86	Pass
NVNT	ac20	5320	Ant2	-9.39	0.3	-9.09	-4.86	Pass

Report

NVNT	ac20	5320	Sum	-6.26	0.3	-5.96	-4.86	Pass
NVNT	ac20	5500	Ant1	-10.29	0.37	-9.92	-5.27	Pass
NVNT	ac20	5500	Ant2	-11.93	0.37	-11.56	-5.27	Pass
NVNT	ac20	5500	Sum	-8.02	0.37	-7.65	-5.27	Pass
NVNT	ac20	5600	Ant1	-10.74	0.37	-10.37	-5.27	Pass
NVNT	ac20	5600	Ant2	-10.73	0.37	-10.36	-5.27	Pass
NVNT	ac20	5600	Sum	-7.72	0.37	-7.35	-5.27	Pass
NVNT	ac20	5700	Ant1	-9.75	0.37	-9.38	-5.27	Pass
NVNT	ac20	5700	Ant2	-9.16	0.37	-8.79	-5.27	Pass
NVNT	ac20	5700	Sum	-6.43	0.37	-6.06	-5.27	Pass
NVNT	ac20	5745	Ant1	-7.13	0.36	-6.77	13.84	Pass
NVNT	ac20	5745	Ant2	-5.71	0.36	-5.35	13.84	Pass
NVNT	ac20	5745	Sum	-3.35	0.36	-2.99	13.84	Pass
NVNT	ac20	5785	Ant1	-7.48	0.36	-7.12	13.84	Pass
NVNT	ac20	5785	Ant2	-6.65	0.36	-6.29	13.84	Pass
NVNT	ac20	5785	Sum	-4.03	0.36	-3.67	13.84	Pass
NVNT	ac20	5825	Ant1	-6.24	0.36	-5.88	13.84	Pass
NVNT	ac20	5825	Ant2	-6.5	0.36	-6.14	13.84	Pass
NVNT	ac20	5825	Sum	-3.36	0.36	-3	13.84	Pass
NVNT	ac40	5190	Ant1	-10.85	0.67	-10.18	1.19	Pass
NVNT	ac40	5190	Ant2	-10.31	0.67	-9.64	1.19	Pass
NVNT	ac40	5190	Sum	-7.56	0.67	-6.89	1.19	Pass
NVNT	ac40	5210	Ant1	-10.93	0.57	-10.36	1.19	Pass
NVNT	ac40	5210	Ant2	-10.17	0.57	-9.6	1.19	Pass
NVNT	ac40	5210	Sum	-7.52	0.57	-6.95	1.19	Pass
NVNT	ac40	5230	Ant1	-10.93	0.57	-10.36	1.19	Pass
NVNT	ac40	5230	Ant2	-10.15	0.57	-9.58	1.19	Pass
NVNT	ac40	5230	Sum	-7.51	0.57	-6.94	1.19	Pass
NVNT	ac40	5270	Ant1	-15.32	1.96	-13.36	-4.86	Pass
NVNT	ac40	5270	Ant2	-14.51	1.96	-12.55	-4.86	Pass
NVNT	ac40	5270	Sum	-11.89	1.96	-9.93	-4.86	Pass
NVNT	ac40	5290	Ant1	-15.18	1.92	-13.26	-4.86	Pass
NVNT	ac40	5290	Ant2	-14.11	1.92	-12.19	-4.86	Pass
NVNT	ac40	5290	Sum	-11.6	1.92	-9.68	-4.86	Pass
NVNT	ac40	5310	Ant1	-15.5	1.96	-13.54	-4.86	Pass
NVNT	ac40	5310	Ant2	-14.98	1.96	-13.02	-4.86	Pass
NVNT	ac40	5310	Sum	-12.22	1.96	-10.26	-4.86	Pass
NVNT	ac40	5510	Ant1	-19.29	2.04	-17.25	-5.27	Pass
NVNT	ac40	5510	Ant2	-20.33	2.04	-18.29	-5.27	Pass
NVNT	ac40	5510	Sum	-16.77	2.04	-14.73	-5.27	Pass
NVNT	ac40	5600	Ant1	-17.21	1.92	-15.29	-5.27	Pass
NVNT	ac40	5600	Ant2	-17.58	1.92	-15.66	-5.27	Pass
NVNT	ac40	5600	Sum	-14.38	1.92	-12.46	-5.27	Pass
NVNT	ac40	5690	Ant1	-16.84	1.96	-14.88	-5.27	Pass

Report

NVNT	ac40	5690	Ant2	-16.92	1.96	-14.96	-5.27	Pass
NVNT	ac40	5690	Sum	-13.87	1.96	-11.91	-5.27	Pass
NVNT	ac40	5755	Ant1	-9.96	0.68	-9.28	13.84	Pass
NVNT	ac40	5755	Ant2	-9.06	0.68	-8.38	13.84	Pass
NVNT	ac40	5755	Sum	-6.48	0.68	-5.8	13.84	Pass
NVNT	ac40	5785	Ant1	-10.5	0.63	-9.87	13.84	Pass
NVNT	ac40	5785	Ant2	-9.19	0.63	-8.56	13.84	Pass
NVNT	ac40	5785	Sum	-6.79	0.63	-6.16	13.84	Pass
NVNT	ac40	5815	Ant1	-10.82	0.63	-10.19	13.84	Pass
NVNT	ac40	5815	Ant2	-9.55	0.63	-8.92	13.84	Pass
NVNT	ac40	5815	Sum	-7.13	0.63	-6.5	13.84	Pass
NVNT	ac80	5210	Ant1	-15.3	1.19	-14.11	1.19	Pass
NVNT	ac80	5210	Ant2	-14.84	1.19	-13.65	1.19	Pass
NVNT	ac80	5210	Sum	-12.05	1.19	-10.86	1.19	Pass
NVNT	ac80	5290	Ant1	-20.08	3.12	-16.96	-4.86	Pass
NVNT	ac80	5290	Ant2	-19.02	3.12	-15.9	-4.86	Pass
NVNT	ac80	5290	Sum	-16.51	3.12	-13.39	-4.86	Pass
NVNT	ac80	5530	Ant1	-22.09	3.12	-18.97	-5.27	Pass
NVNT	ac80	5530	Ant2	-22.37	3.12	-19.25	-5.27	Pass
NVNT	ac80	5530	Sum	-19.22	3.12	-16.1	-5.27	Pass
NVNT	ac80	5600	Ant1	-21.71	3.12	-18.59	-5.27	Pass
NVNT	ac80	5600	Ant2	-21.14	3.12	-18.02	-5.27	Pass
NVNT	ac80	5600	Sum	-18.41	3.12	-15.29	-5.27	Pass
NVNT	ac80	5670	Ant1	-21.41	3.23	-18.18	-5.27	Pass
NVNT	ac80	5670	Ant2	-21.8	3.23	-18.57	-5.27	Pass
NVNT	ac80	5670	Sum	-18.59	3.23	-15.36	-5.27	Pass
NVNT	ac80	5775	Ant1	-13.36	1.13	-12.23	13.84	Pass
NVNT	ac80	5775	Ant2	-12.22	1.13	-11.09	13.84	Pass
NVNT	ac80	5775	Sum	-9.74	1.13	-8.61	13.84	Pass
NVNT	ac80	5785	Ant1	-13.48	1.2	-12.28	13.84	Pass
NVNT	ac80	5785	Ant2	-12.56	1.2	-11.36	13.84	Pass
NVNT	ac80	5785	Sum	-9.99	1.2	-8.79	13.84	Pass
NVNT	ac80	5795	Ant1	-13.61	1.14	-12.47	13.84	Pass
NVNT	ac80	5795	Ant2	-12.51	1.14	-11.37	13.84	Pass
NVNT	ac80	5795	Sum	-10.01	1.14	-8.87	13.84	Pass
NVNT	n20	5180	Ant1	-7.96	0.16	-7.8	1.19	Pass
NVNT	n20	5180	Ant2	-7.45	0.16	-7.29	1.19	Pass
NVNT	n20	5180	Sum	-4.69	0.16	-4.53	1.19	Pass
NVNT	n20	5210	Ant1	-8.6	0.19	-8.41	1.19	Pass
NVNT	n20	5210	Ant2	-8.06	0.19	-7.87	1.19	Pass
NVNT	n20	5210	Sum	-5.31	0.19	-5.12	1.19	Pass
NVNT	n20	5240	Ant1	-2.94	0.19	-2.75	1.19	Pass
NVNT	n20	5240	Ant2	-1.97	0.19	-1.78	1.19	Pass
NVNT	n20	5240	Sum	0.58	0.19	0.77	1.19	Pass

Report

NVNT	n20	5260	Ant1	-9.51	0.16	-9.35	-4.86	Pass
NVNT	n20	5260	Ant2	-8.08	0.16	-7.92	-4.86	Pass
NVNT	n20	5260	Sum	-5.73	0.16	-5.57	-4.86	Pass
NVNT	n20	5290	Ant1	-8.96	0.19	-8.77	-4.86	Pass
NVNT	n20	5290	Ant2	-7.75	0.19	-7.56	-4.86	Pass
NVNT	n20	5290	Sum	-5.3	0.19	-5.11	-4.86	Pass
NVNT	n20	5320	Ant1	-8.98	0.19	-8.79	-4.86	Pass
NVNT	n20	5320	Ant2	-9.1	0.19	-8.91	-4.86	Pass
NVNT	n20	5320	Sum	-6.03	0.19	-5.84	-4.86	Pass
NVNT	n20	5500	Ant1	-8.99	0.2	-8.79	-5.27	Pass
NVNT	n20	5500	Ant2	-8.75	0.2	-8.55	-5.27	Pass
NVNT	n20	5500	Sum	-5.86	0.2	-5.66	-5.27	Pass
NVNT	n20	5600	Ant1	-8.54	0.16	-8.38	-5.27	Pass
NVNT	n20	5600	Ant2	-8.71	0.16	-8.55	-5.27	Pass
NVNT	n20	5600	Sum	-5.61	0.16	-5.45	-5.27	Pass
NVNT	n20	5700	Ant1	-9.08	0.2	-8.88	-5.27	Pass
NVNT	n20	5700	Ant2	-8.21	0.2	-8.01	-5.27	Pass
NVNT	n20	5700	Sum	-5.61	0.2	-5.41	-5.27	Pass
NVNT	n20	5745	Ant1	-6.75	0.19	-6.56	13.84	Pass
NVNT	n20	5745	Ant2	-5.65	0.19	-5.46	13.84	Pass
NVNT	n20	5745	Sum	-3.15	0.19	-2.96	13.84	Pass
NVNT	n20	5785	Ant1	-7.23	0.19	-7.04	13.84	Pass
NVNT	n20	5785	Ant2	-6.49	0.19	-6.3	13.84	Pass
NVNT	n20	5785	Sum	-3.83	0.19	-3.64	13.84	Pass
NVNT	n20	5825	Ant1	-6.29	0.16	-6.13	13.84	Pass
NVNT	n20	5825	Ant2	-6.2	0.16	-6.04	13.84	Pass
NVNT	n20	5825	Sum	-3.23	0.16	-3.07	13.84	Pass
NVNT	n40	5190	Ant1	-10.53	0.32	-10.21	1.19	Pass
NVNT	n40	5190	Ant2	-10.15	0.32	-9.83	1.19	Pass
NVNT	n40	5190	Sum	-7.33	0.32	-7.01	1.19	Pass
NVNT	n40	5210	Ant1	-10.3	0.38	-9.92	1.19	Pass
NVNT	n40	5210	Ant2	-9.71	0.38	-9.33	1.19	Pass
NVNT	n40	5210	Sum	-6.98	0.38	-6.6	1.19	Pass
NVNT	n40	5230	Ant1	-10.66	0.38	-10.28	1.19	Pass
NVNT	n40	5230	Ant2	-9.39	0.38	-9.01	1.19	Pass
NVNT	n40	5230	Sum	-6.97	0.38	-6.59	1.19	Pass
NVNT	n40	5270	Ant1	-17.42	1.17	-16.25	-4.86	Pass
NVNT	n40	5270	Ant2	-16.02	1.17	-14.85	-4.86	Pass
NVNT	n40	5270	Sum	-13.65	1.17	-12.48	-4.86	Pass
NVNT	n40	5290	Ant1	-16.59	1.17	-15.42	-4.86	Pass
NVNT	n40	5290	Ant2	-15.43	1.17	-14.26	-4.86	Pass
NVNT	n40	5290	Sum	-12.96	1.17	-11.79	-4.86	Pass
NVNT	n40	5310	Ant1	-14.29	1.13	-13.16	-4.86	Pass
NVNT	n40	5310	Ant2	-14.19	1.13	-13.06	-4.86	Pass


Report

NVNT	n40	5310	Sum	-11.23	1.13	-10.1	-4.86	Pass
NVNT	n40	5510	Ant1	-17.95	1.17	-16.78	-5.27	Pass
NVNT	n40	5510	Ant2	-19.17	1.17	-18	-5.27	Pass
NVNT	n40	5510	Sum	-15.51	1.17	-14.34	-5.27	Pass
NVNT	n40	5600	Ant1	-16.54	0.38	-16.16	-5.27	Pass
NVNT	n40	5600	Ant2	-15.88	0.38	-15.5	-5.27	Pass
NVNT	n40	5600	Sum	-13.19	0.38	-12.81	-5.27	Pass
NVNT	n40	5690	Ant1	-16.02	1.17	-14.85	-5.27	Pass
NVNT	n40	5690	Ant2	-16.47	1.17	-15.3	-5.27	Pass
NVNT	n40	5690	Sum	-13.23	1.17	-12.06	-5.27	Pass
NVNT	n40	5755	Ant1	-9.83	0.32	-9.51	13.84	Pass
NVNT	n40	5755	Ant2	-8.88	0.32	-8.56	13.84	Pass
NVNT	n40	5755	Sum	-6.32	0.32	-6	13.84	Pass
NVNT	n40	5785	Ant1	-10.16	0.38	-9.78	13.84	Pass
NVNT	n40	5785	Ant2	-9.71	0.38	-9.33	13.84	Pass
NVNT	n40	5785	Sum	-6.92	0.38	-6.54	13.84	Pass
NVNT	n40	5815	Ant1	-10.44	0.38	-10.06	13.84	Pass
NVNT	n40	5815	Ant2	-9.52	0.38	-9.14	13.84	Pass
NVNT	n40	5815	Sum	-6.95	0.38	-6.57	13.84	Pass


Report

Test Graphs

PSD NVNT a 5180MHz Ant1

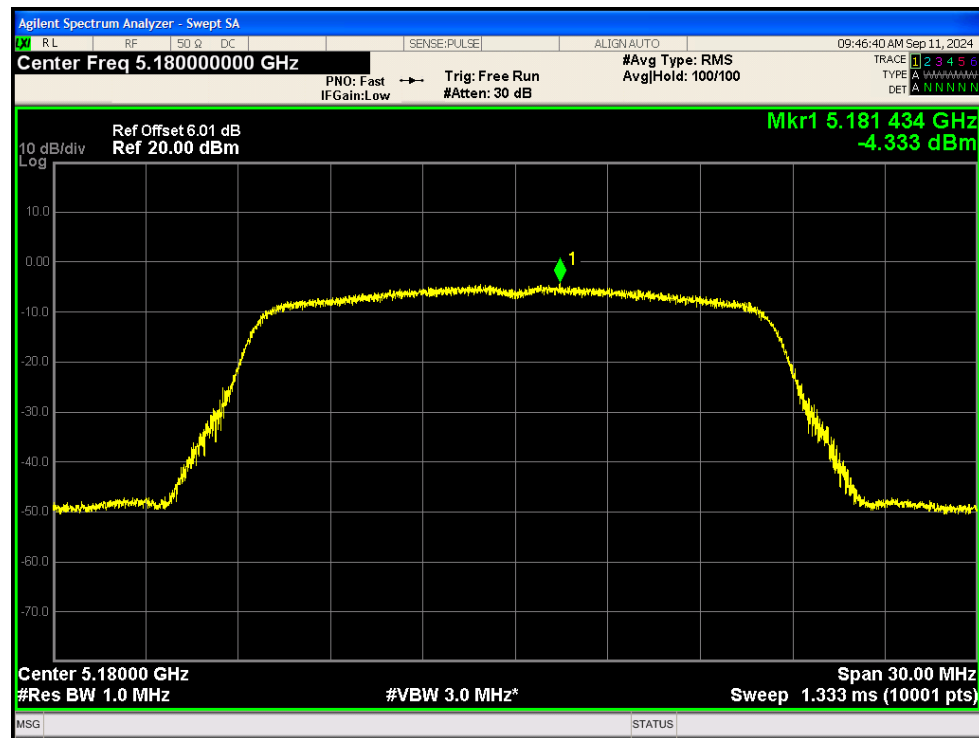


PSD NVNT a 5210MHz Ant1

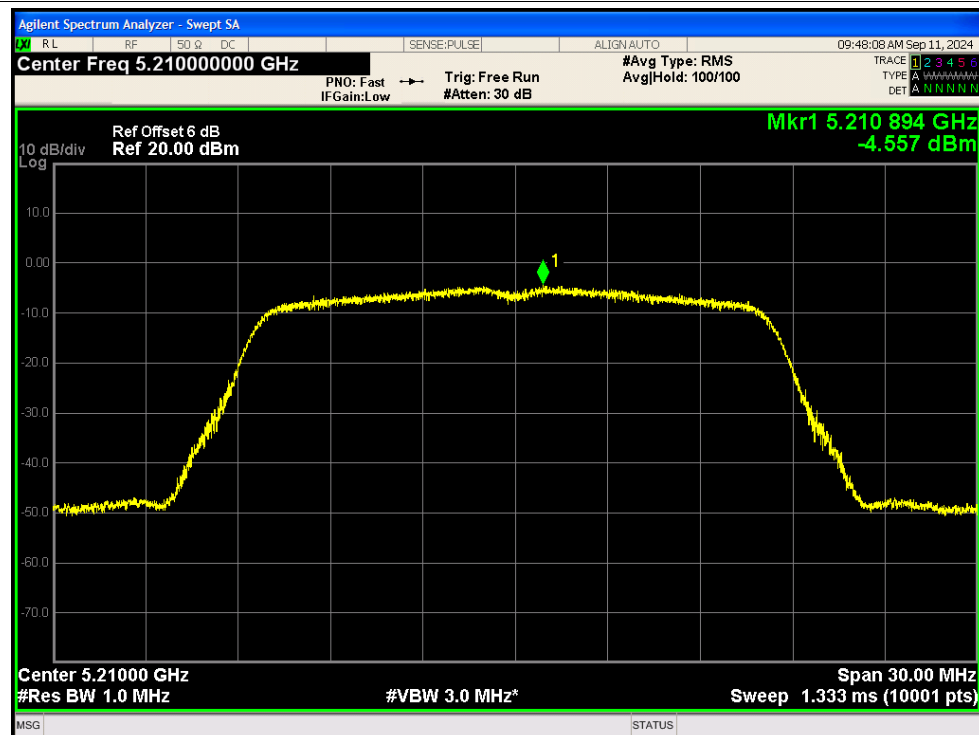


PSD NVNT a 5240MHz Ant1

Report

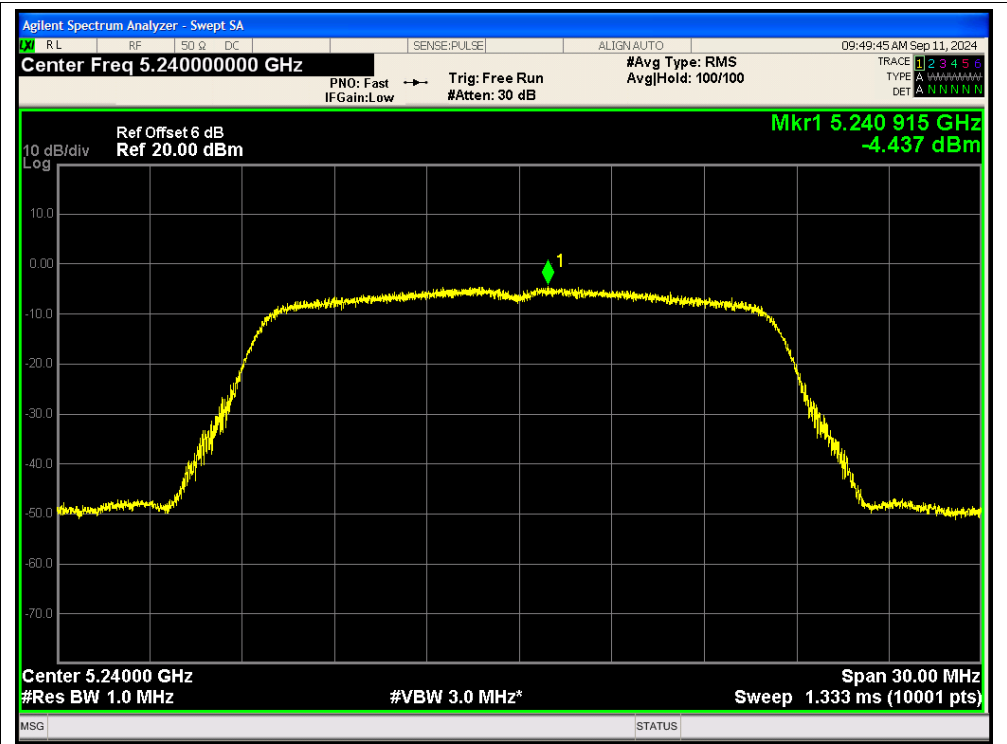


PSD NVNT a 5260MHz Ant1

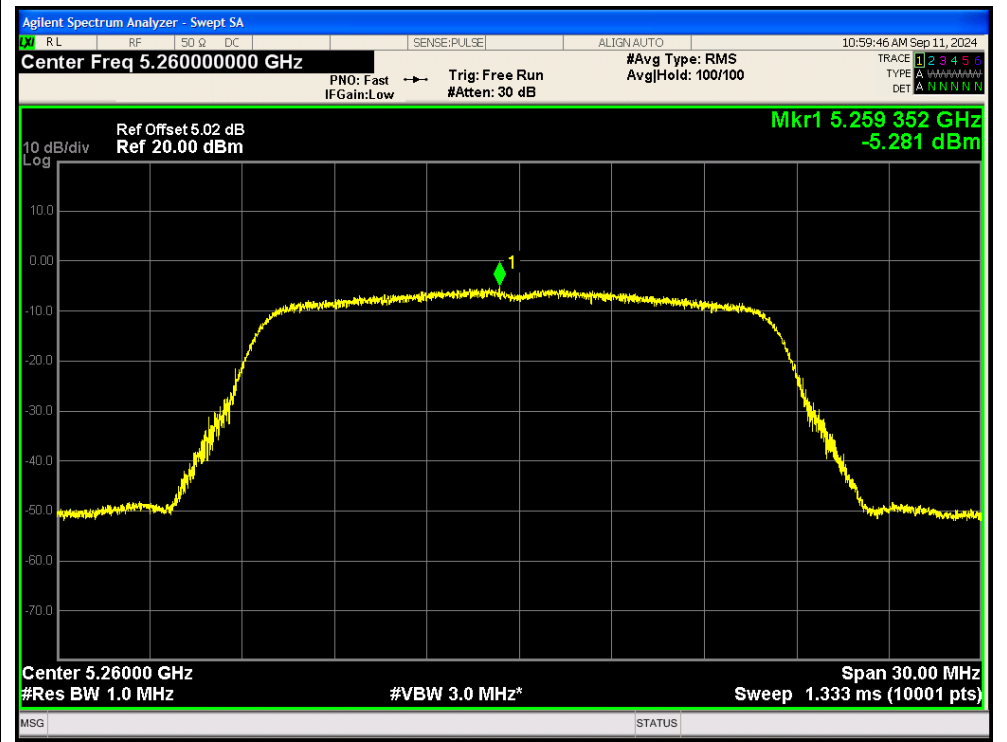


PSD NVNT a 5290MHz Ant1

Report

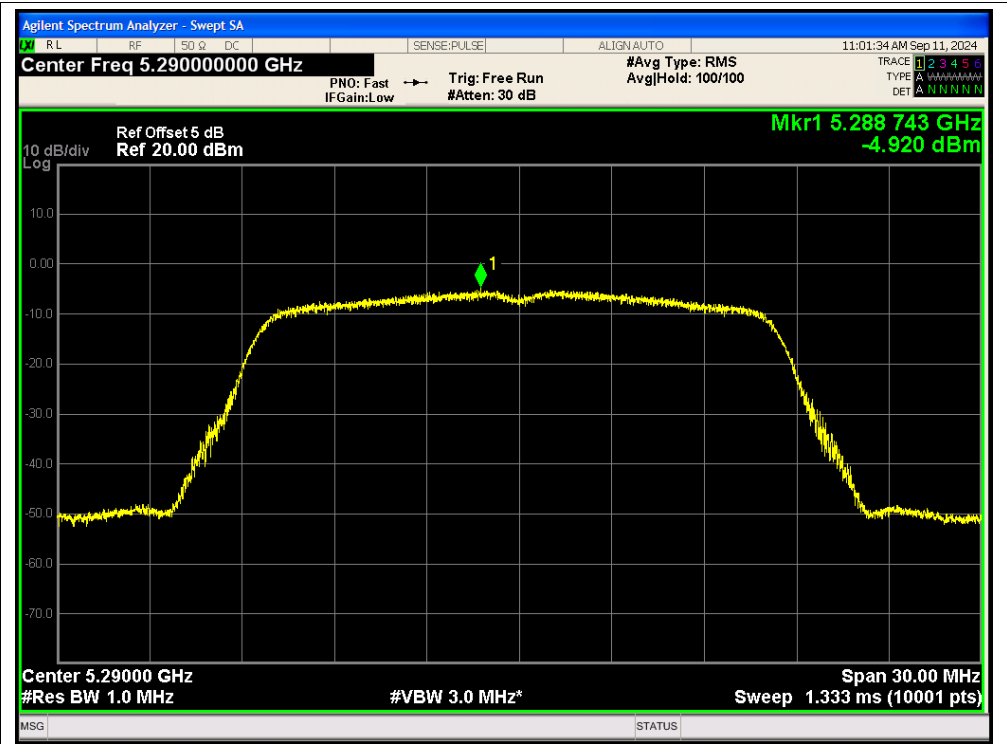


PSD NVNT a 5320MHz Ant1

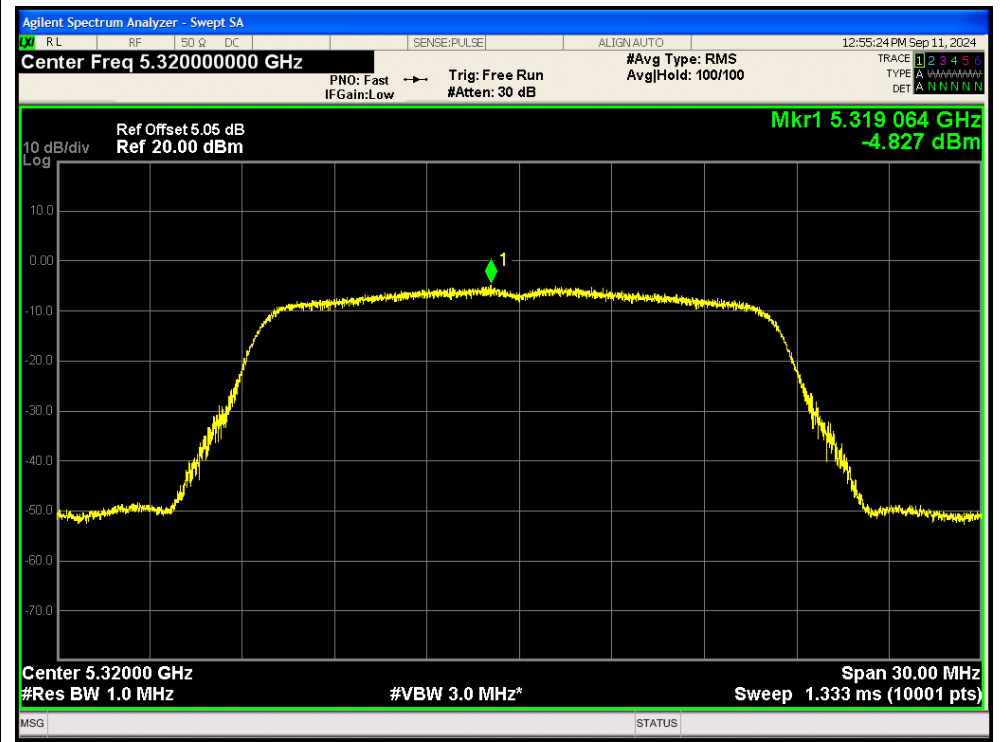


PSD NVNT a 5500MHz Ant1

Report

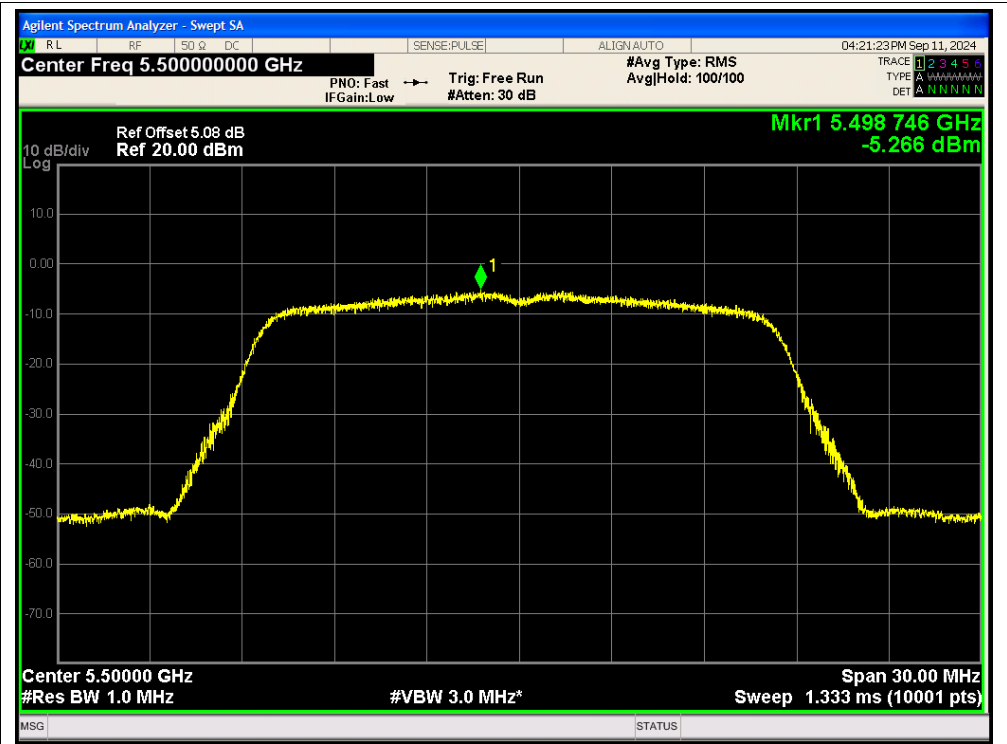


PSD NVNT a 5600MHz Ant1

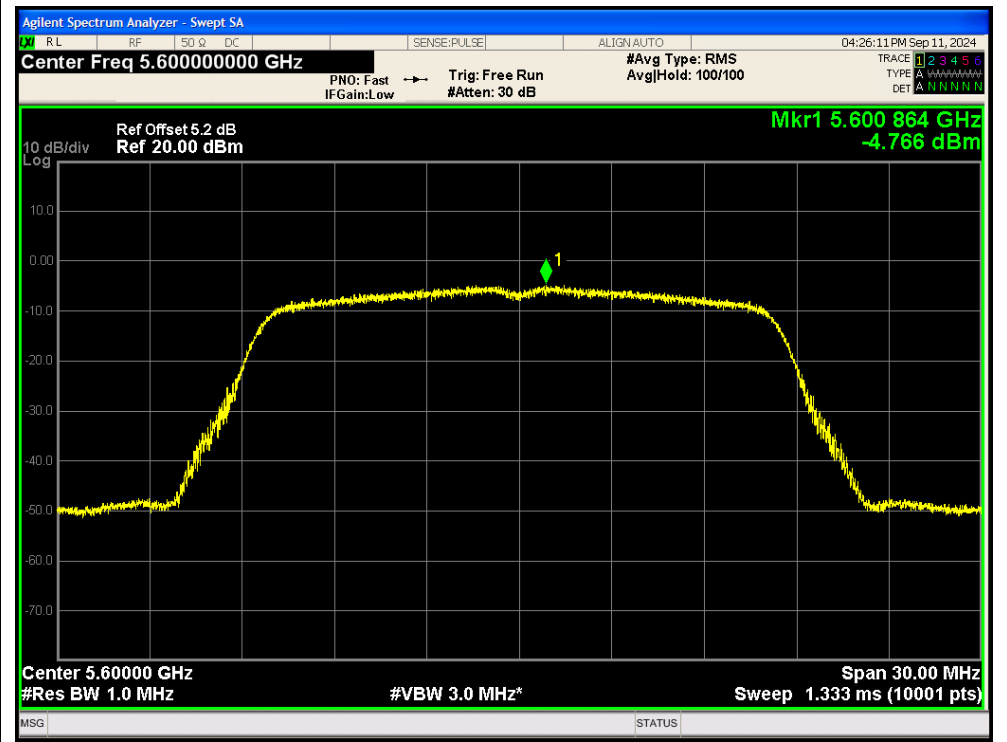


PSD NVNT a 5700MHz Ant1

Report

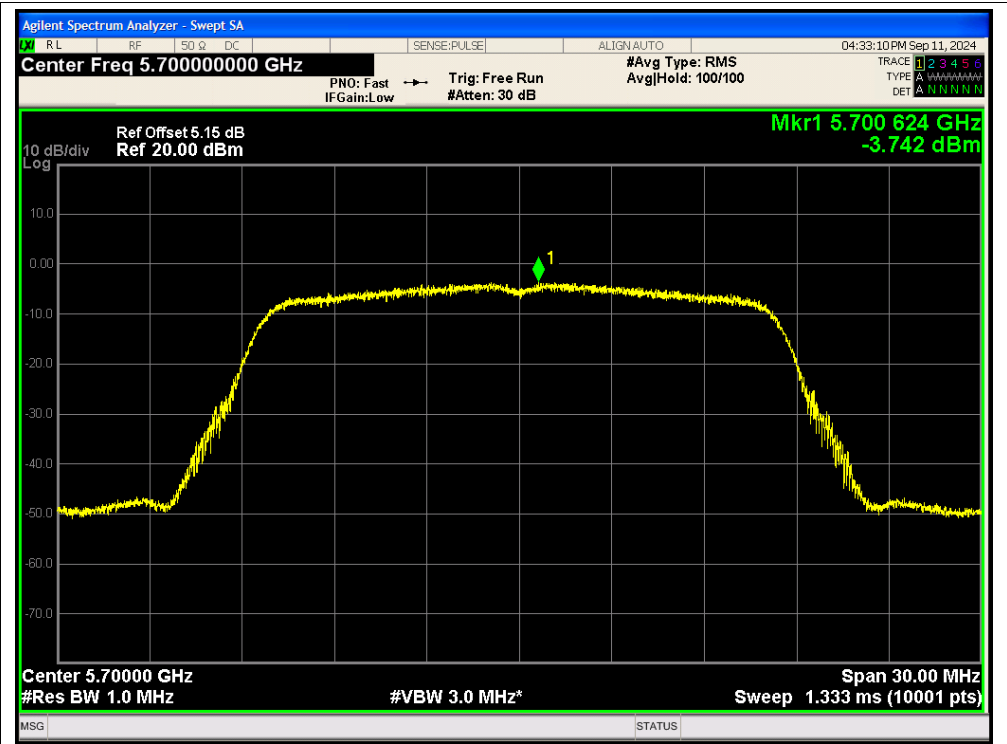


PSD NVNT a 5180MHz Ant2

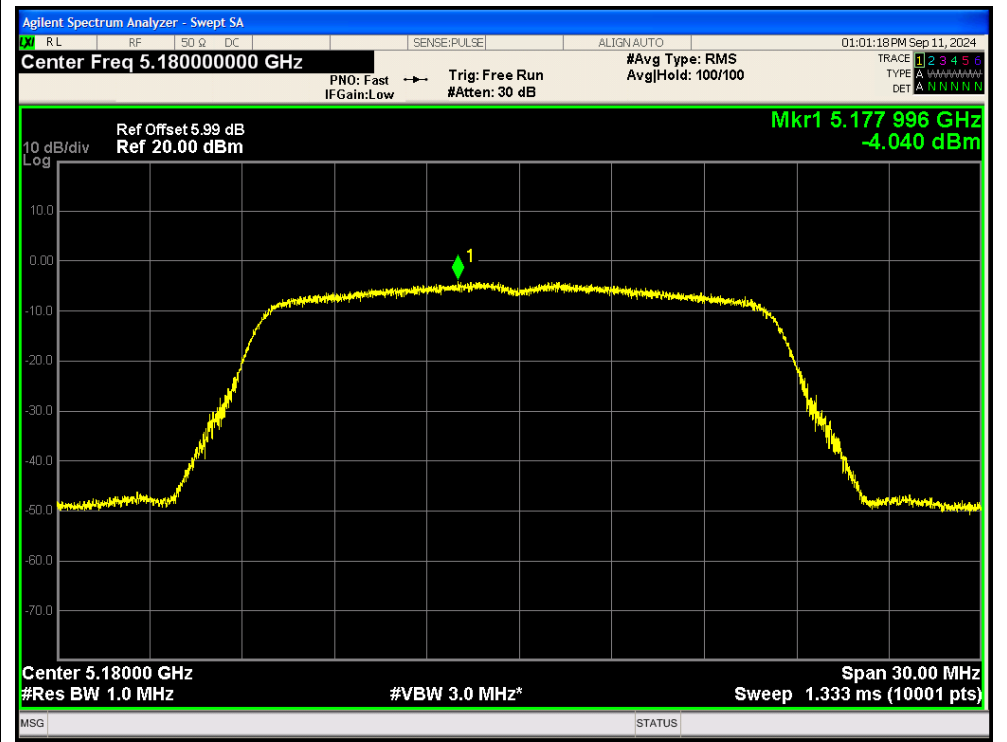


PSD NVNT a 5210MHz Ant2

Report

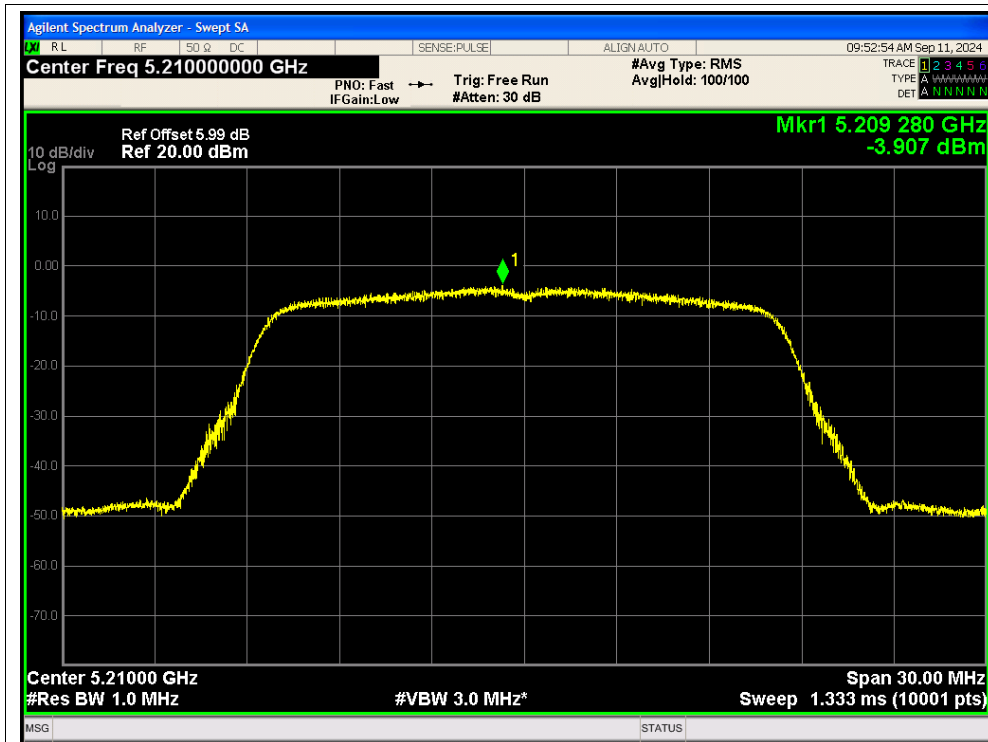


PSD NVNT a 5240MHz Ant2

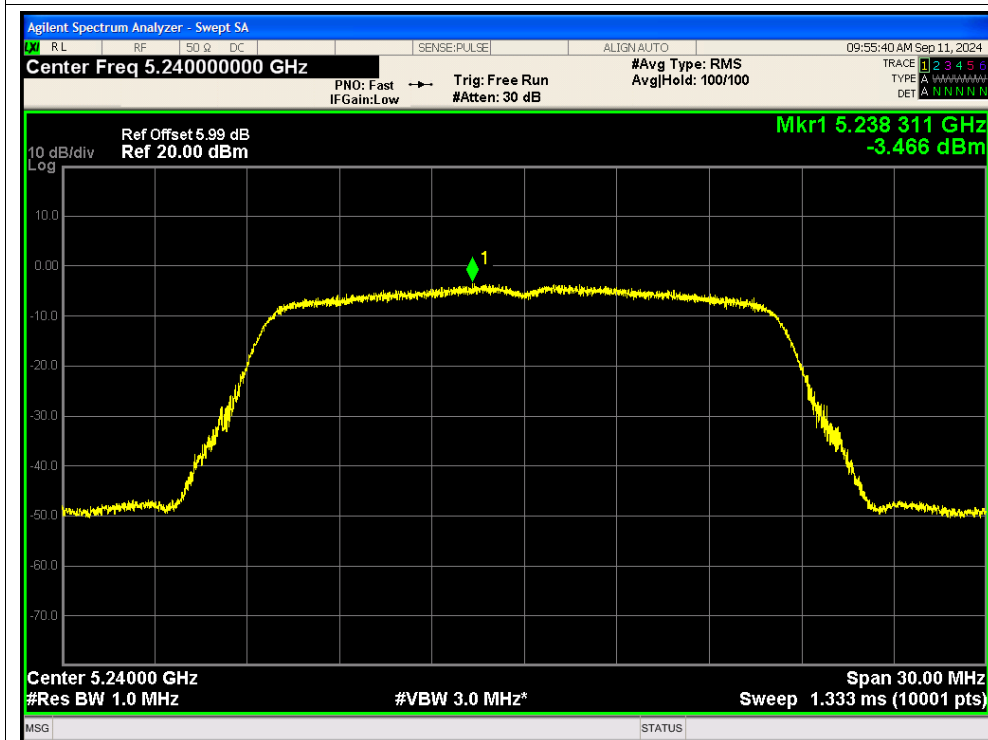


PSD NVNT a 5260MHz Ant2

Report

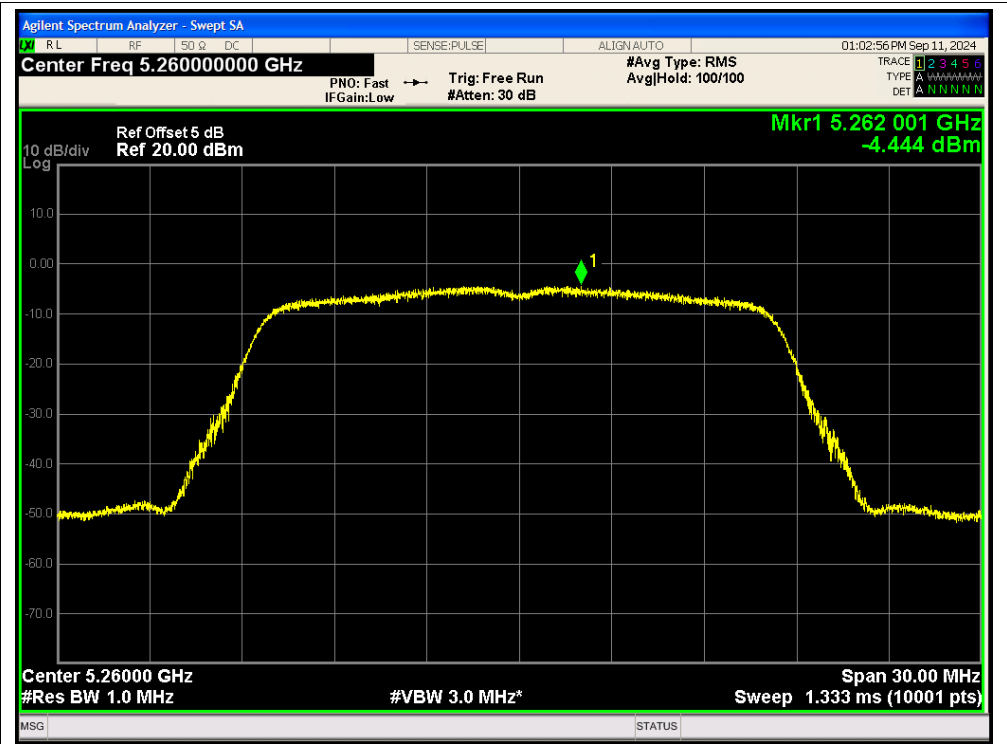


PSD NVNT a 5290MHz Ant2

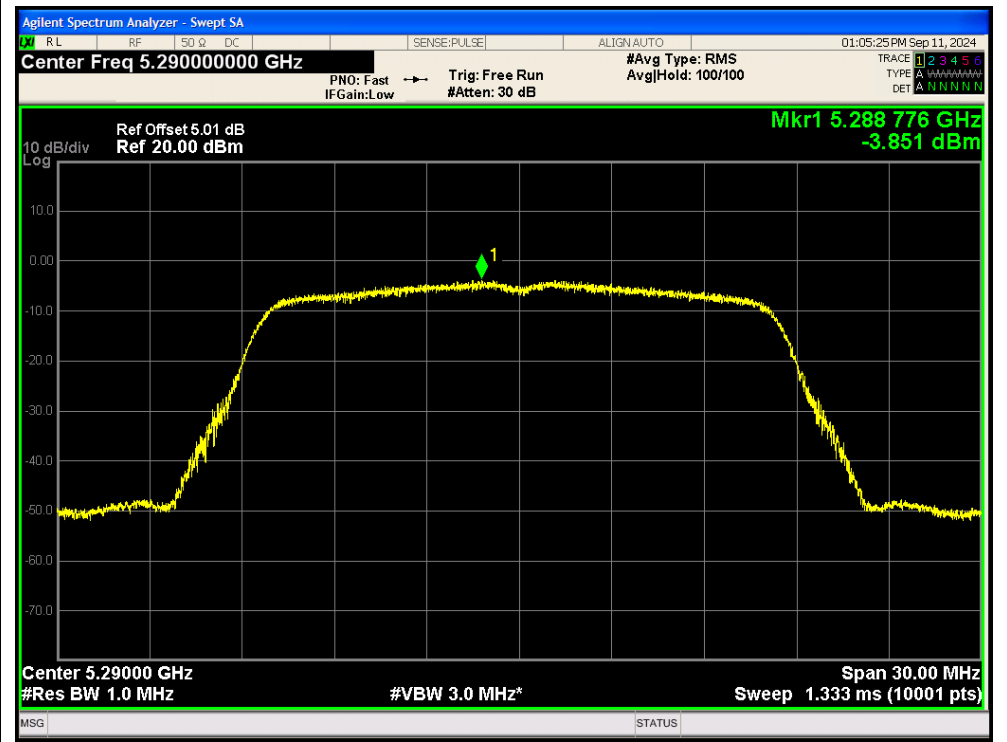


PSD NVNT a 5320MHz Ant2

Report

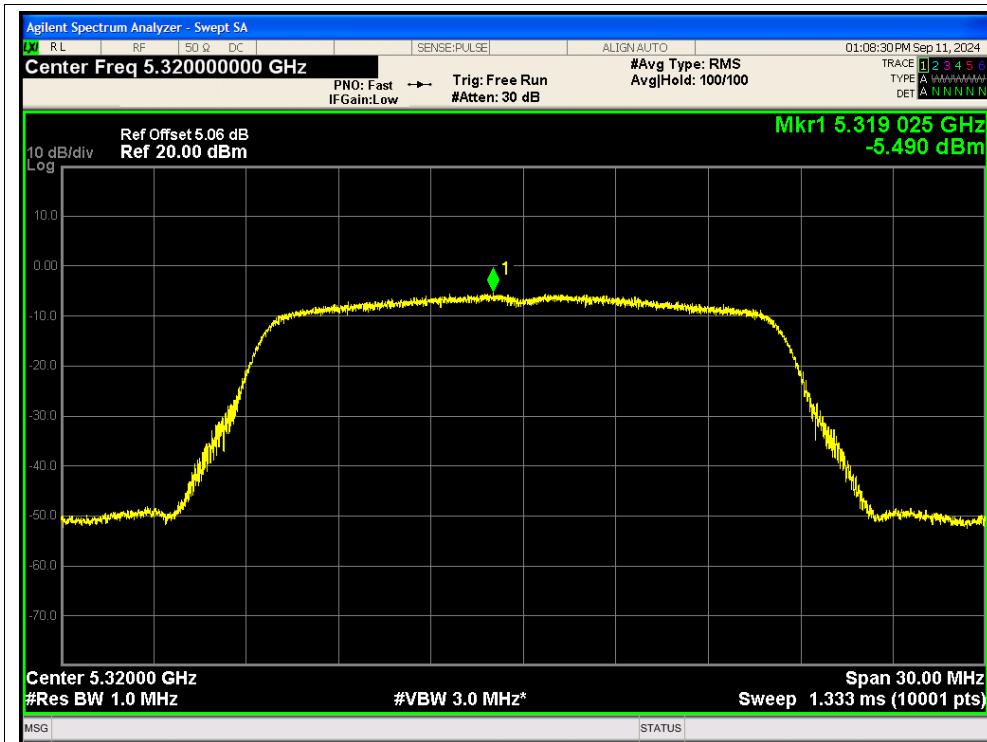


PSD NVNT a 5500MHz Ant2

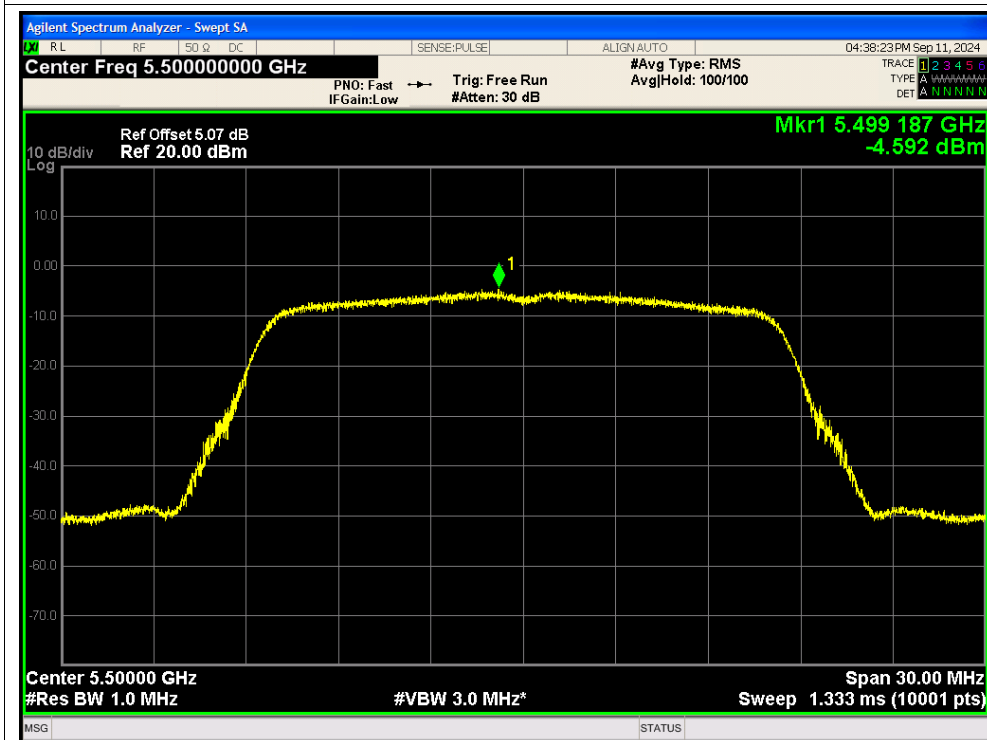


PSD NVNT a 5600MHz Ant2

Report

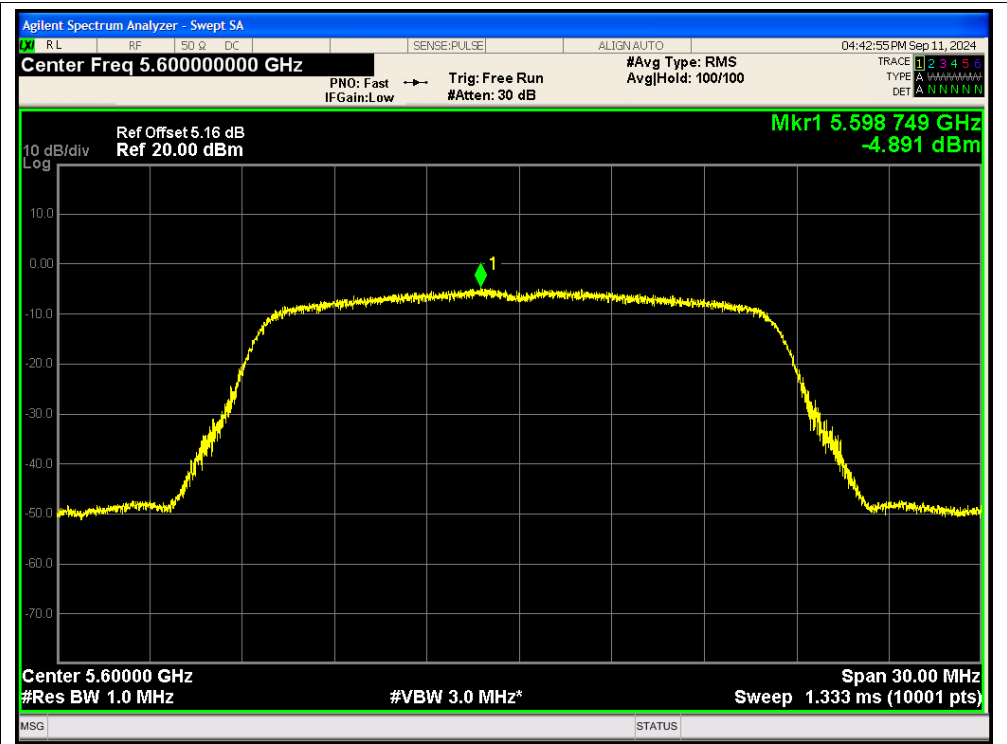


PSD NVNT a 5700MHz Ant2

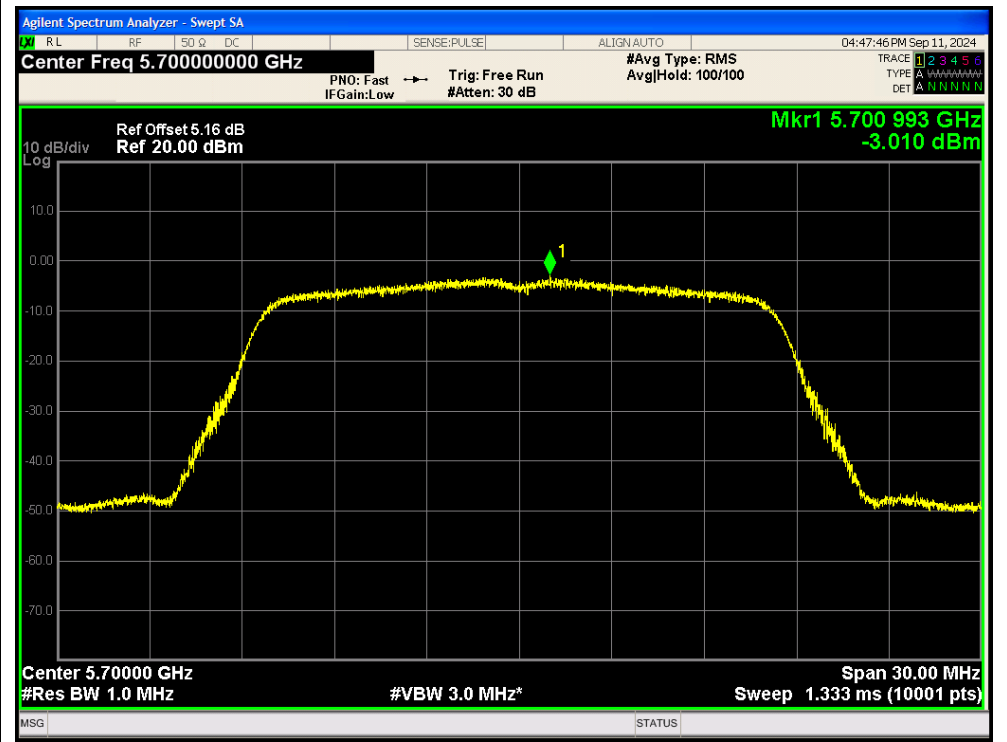


PSD NVNT a 5745MHz Ant1

Report

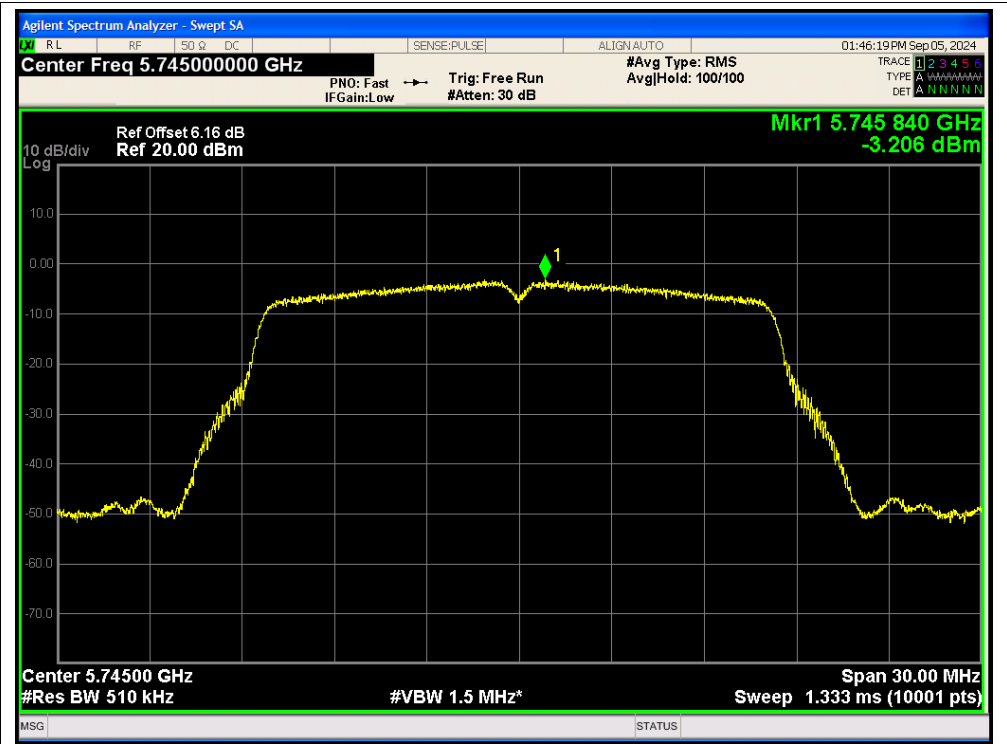


PSD NVNT a 5785MHz Ant1

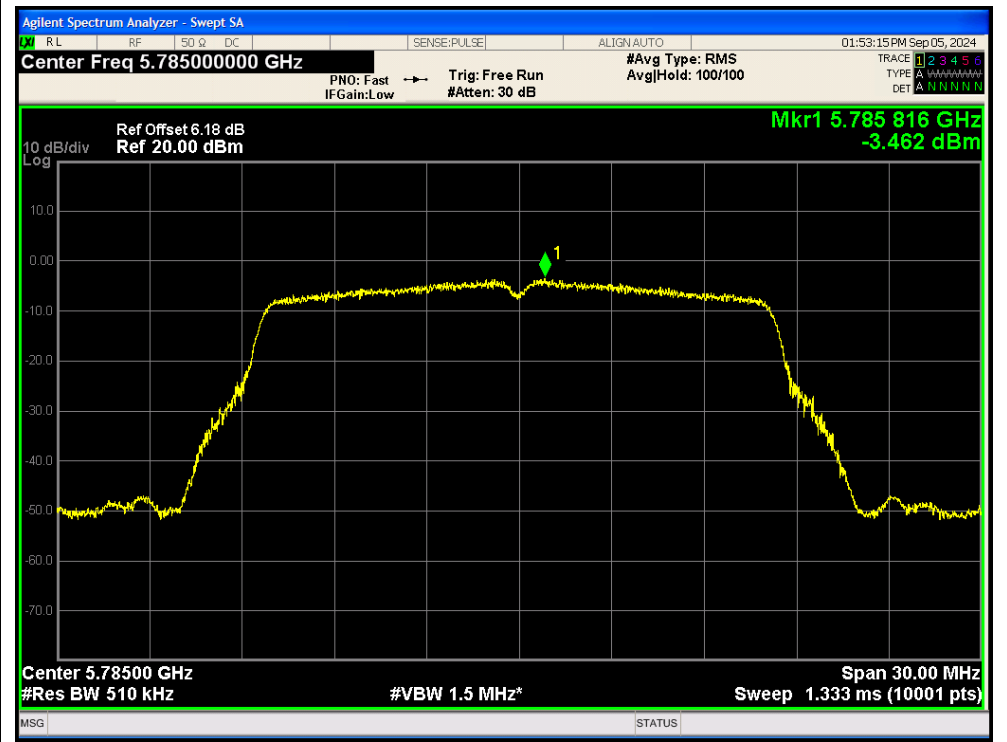


PSD NVNT a 5825MHz Ant1

Report

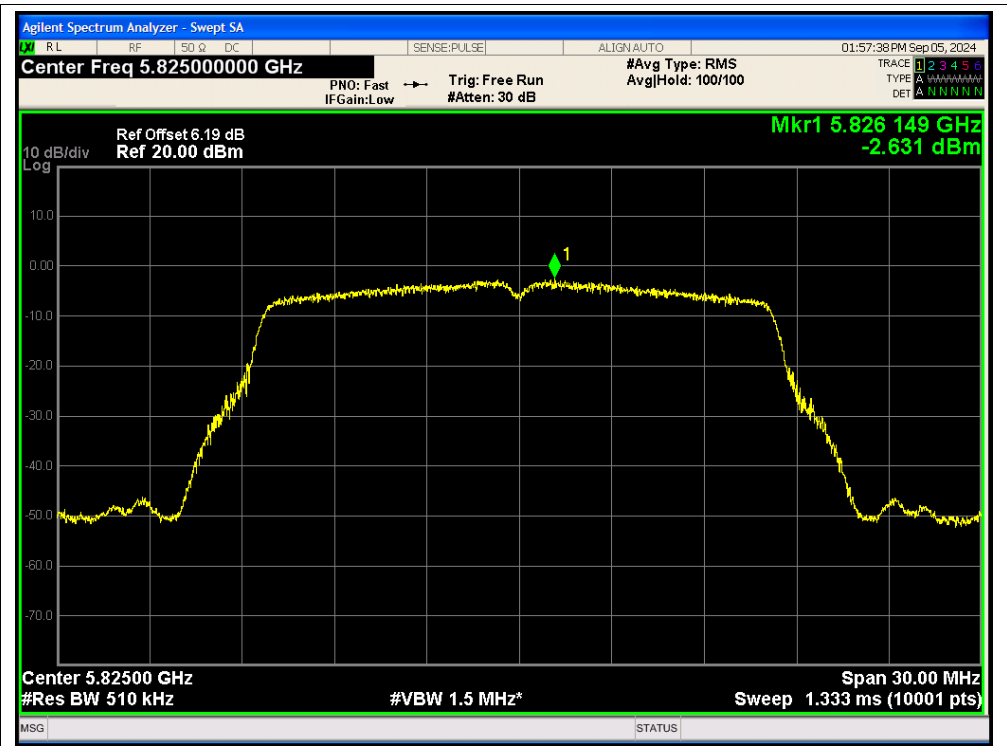


PSD NVNT a 5745MHz Ant2

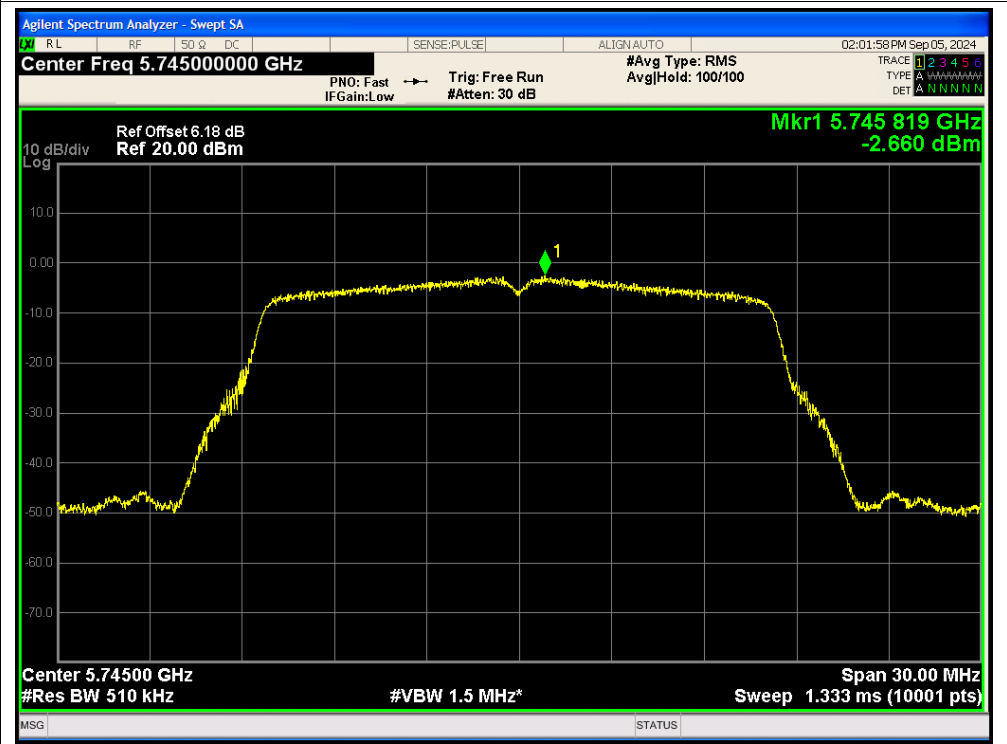


PSD NVNT a 5785MHz Ant2

Report

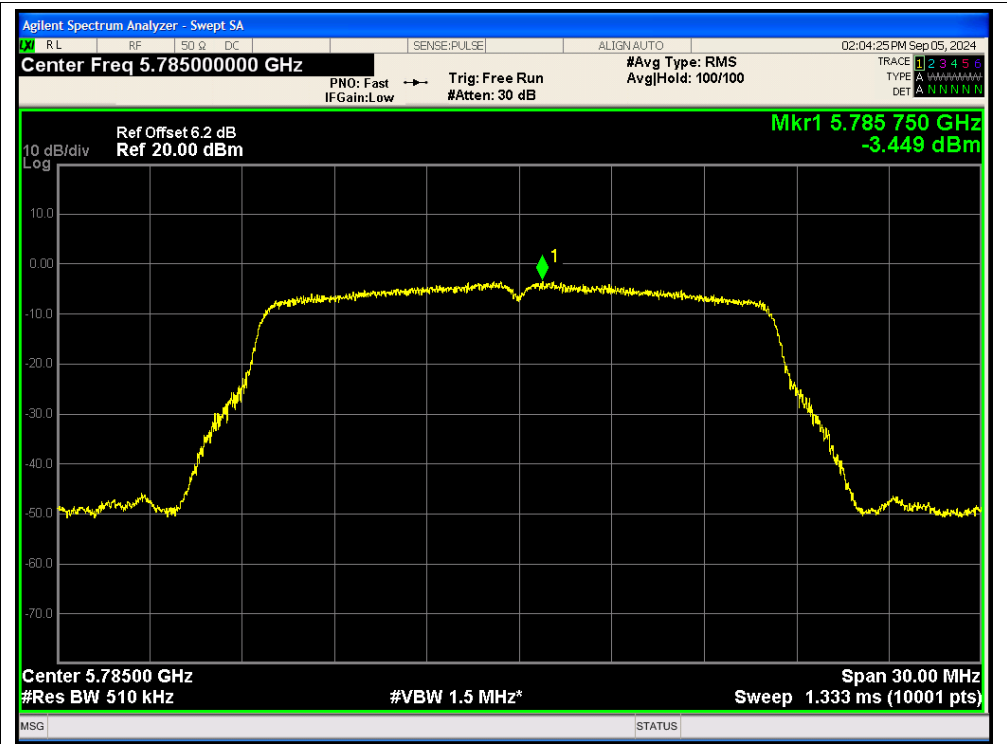


PSD NVNT a 5825MHz Ant2

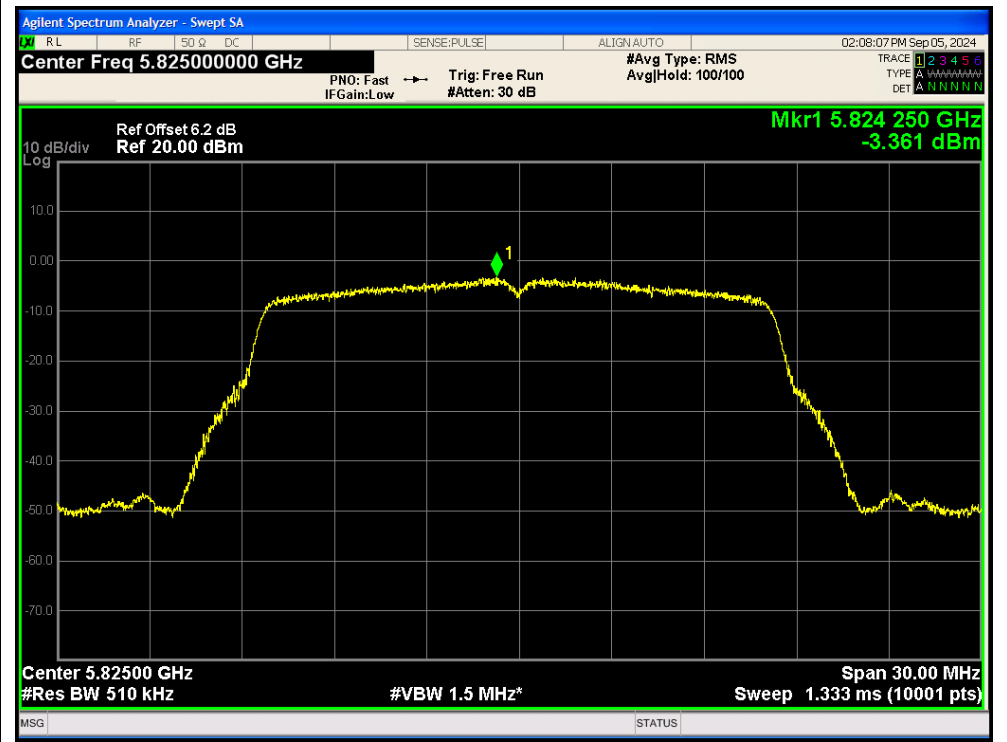


PSD NVNT ac20 5180MHz Ant1

Report

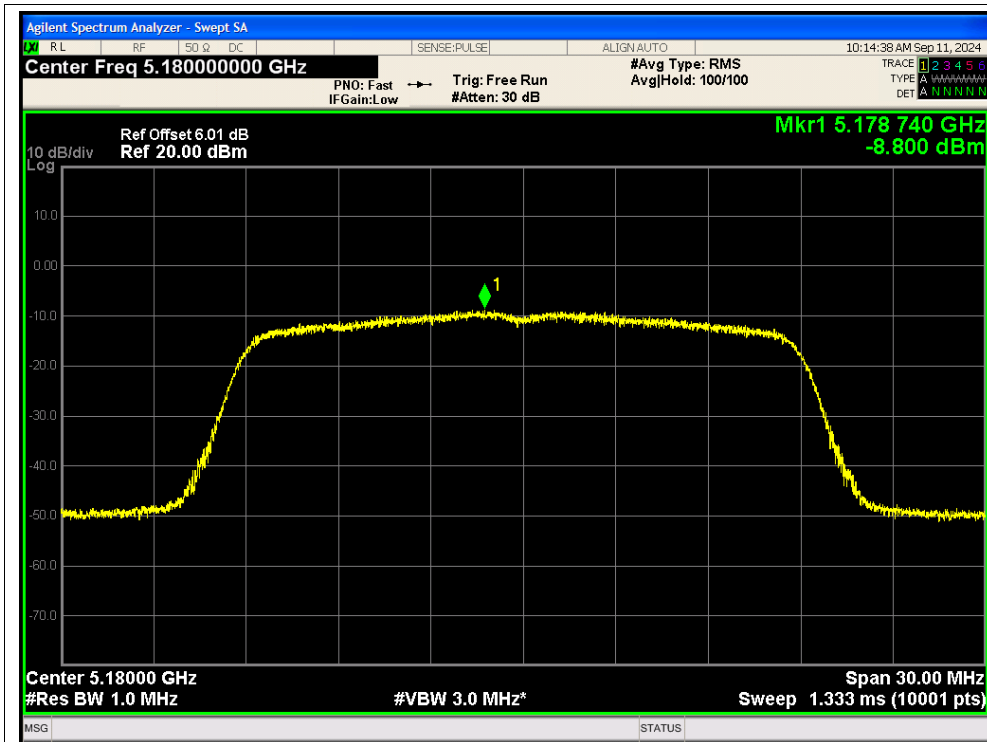


PSD NVNT ac20 5180MHz Ant2

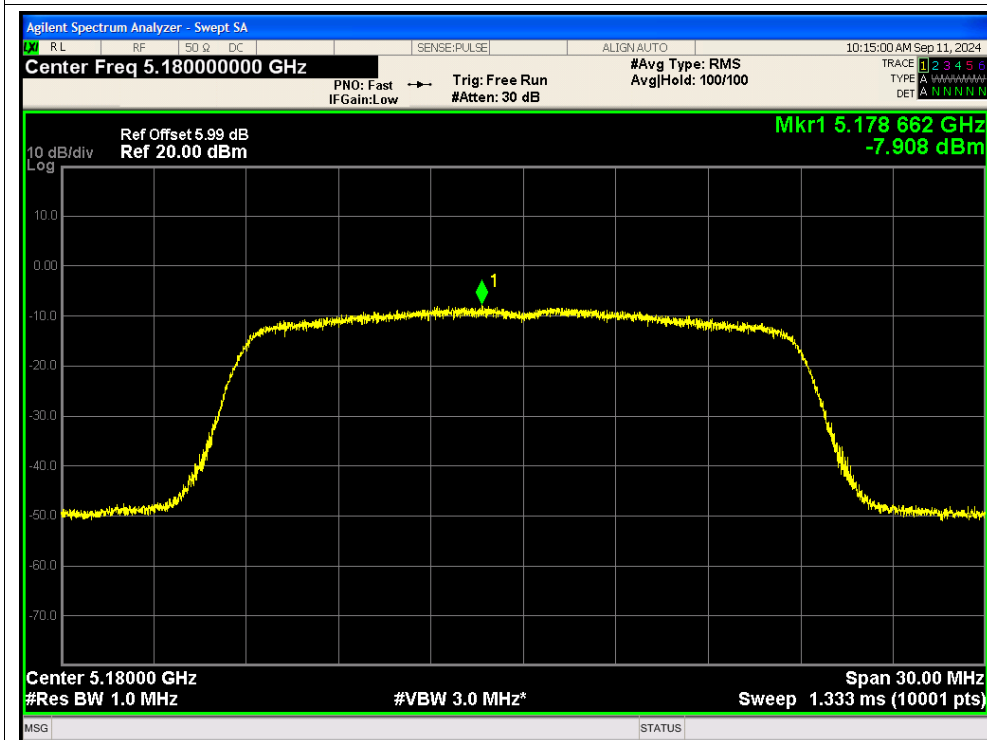


PSD NVNT ac20 5210MHz Ant1

Report

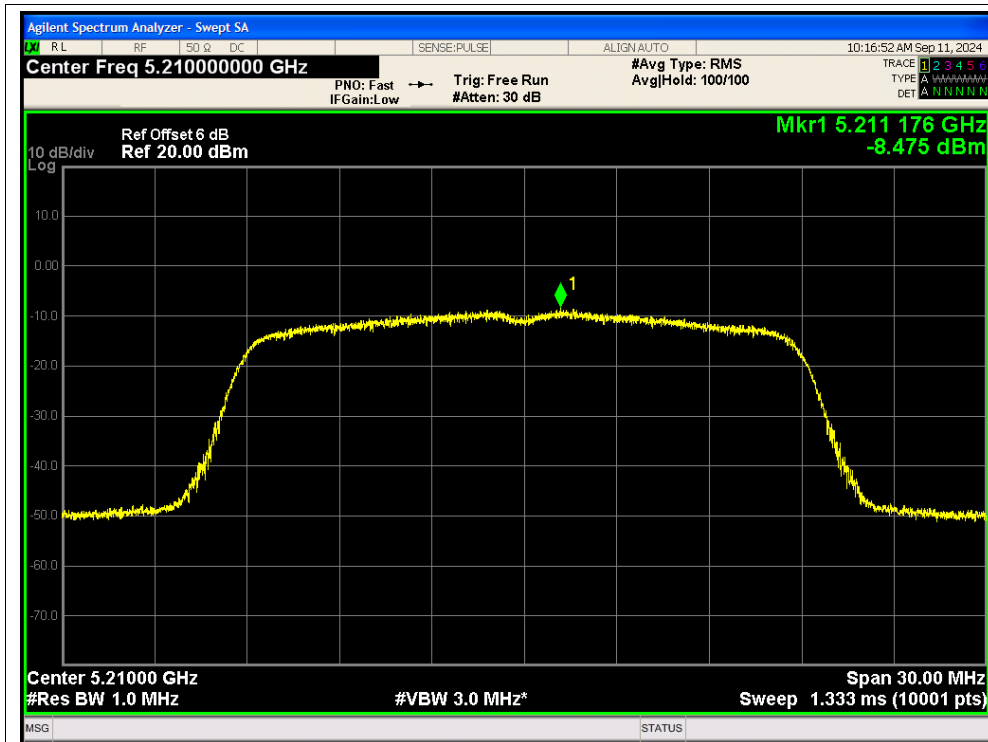


PSD NVNT ac20 5210MHz Ant2

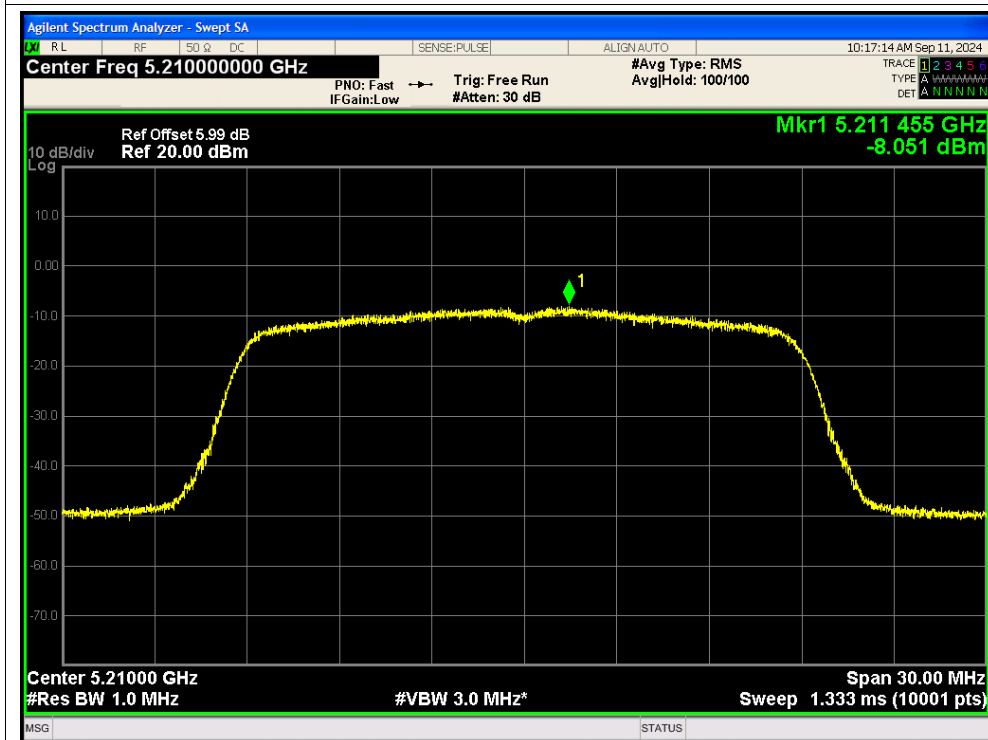


PSD NVNT ac20 5240MHz Ant1

Report

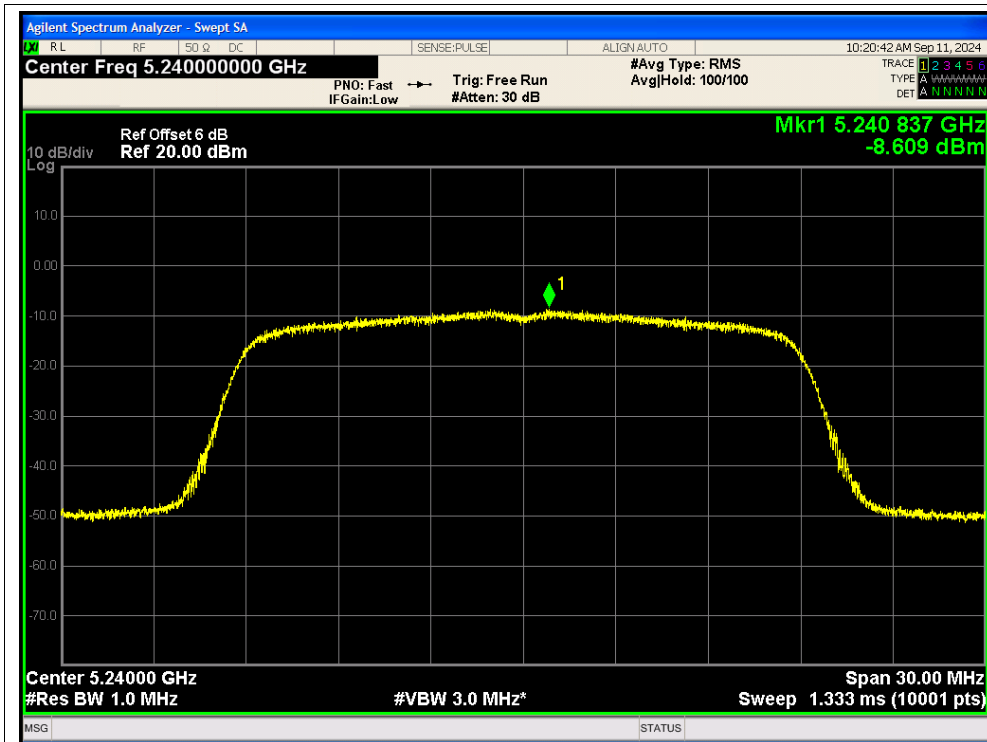


PSD NVNT ac20 5240MHz Ant2

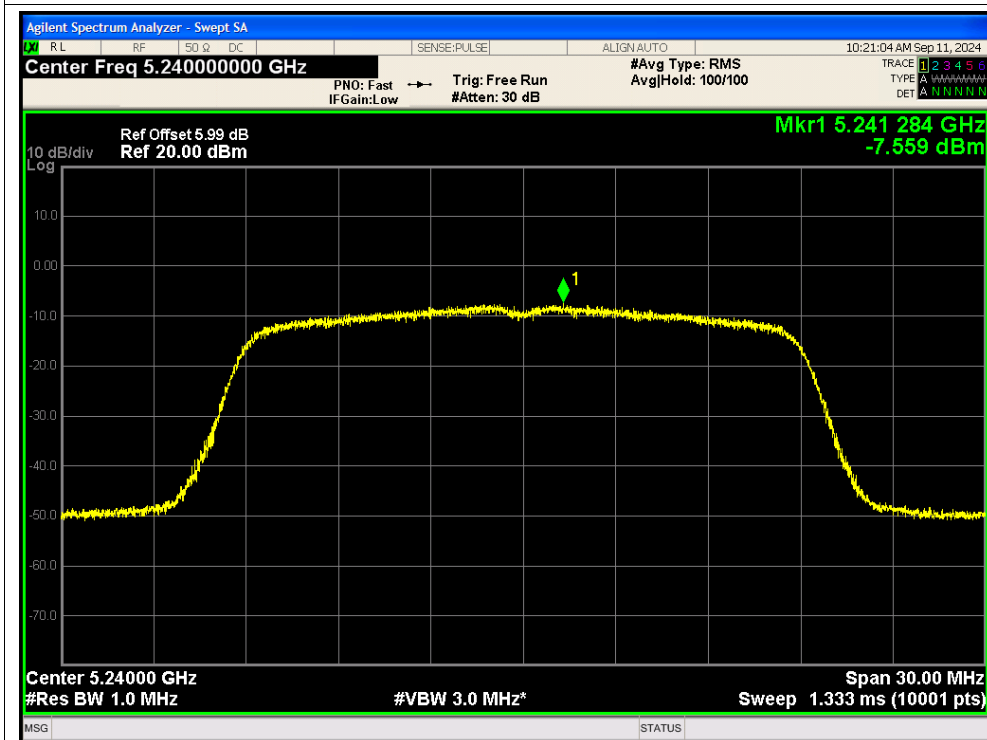


PSD NVNT ac20 5260MHz Ant1

Report

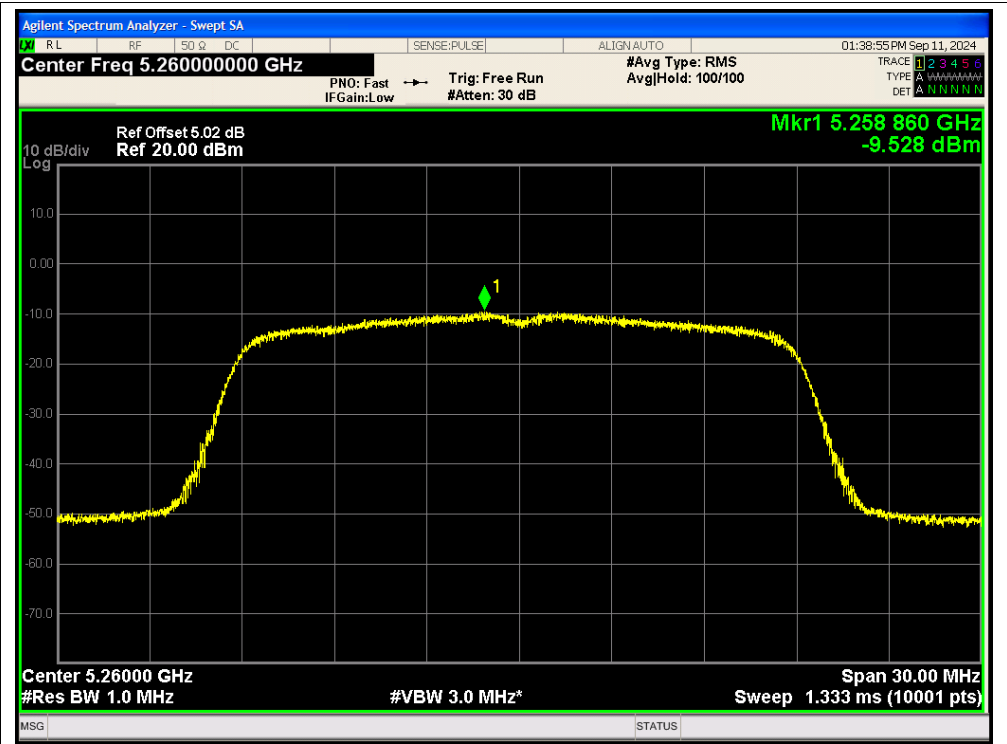


PSD NVNT ac20 5260MHz Ant2

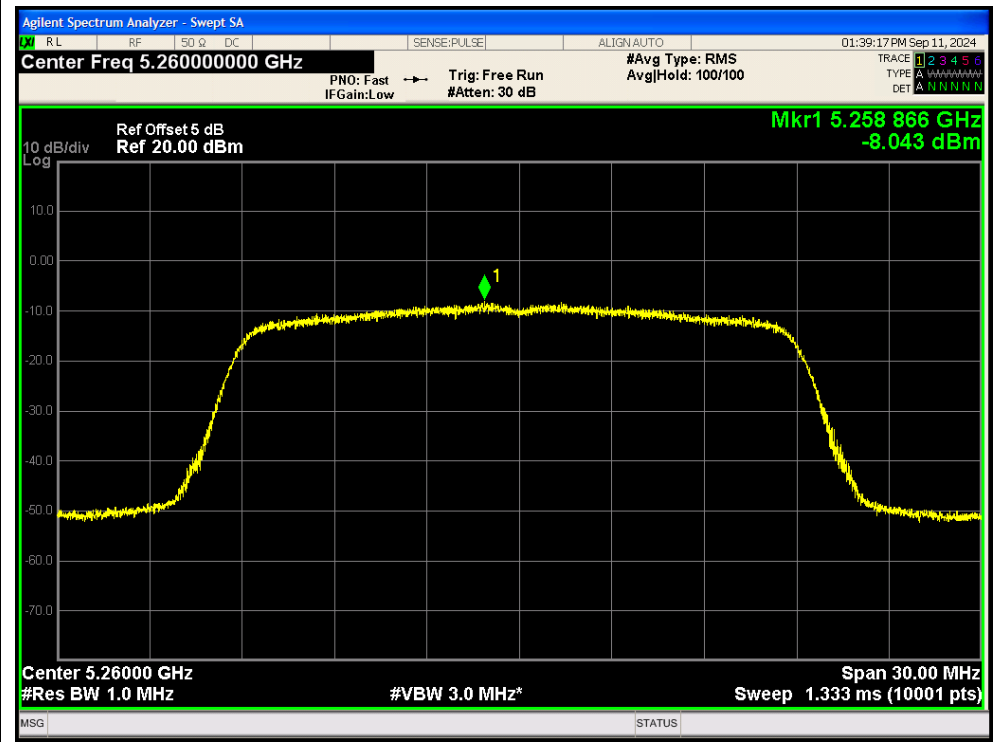


PSD NVNT ac20 5290MHz Ant1

Report

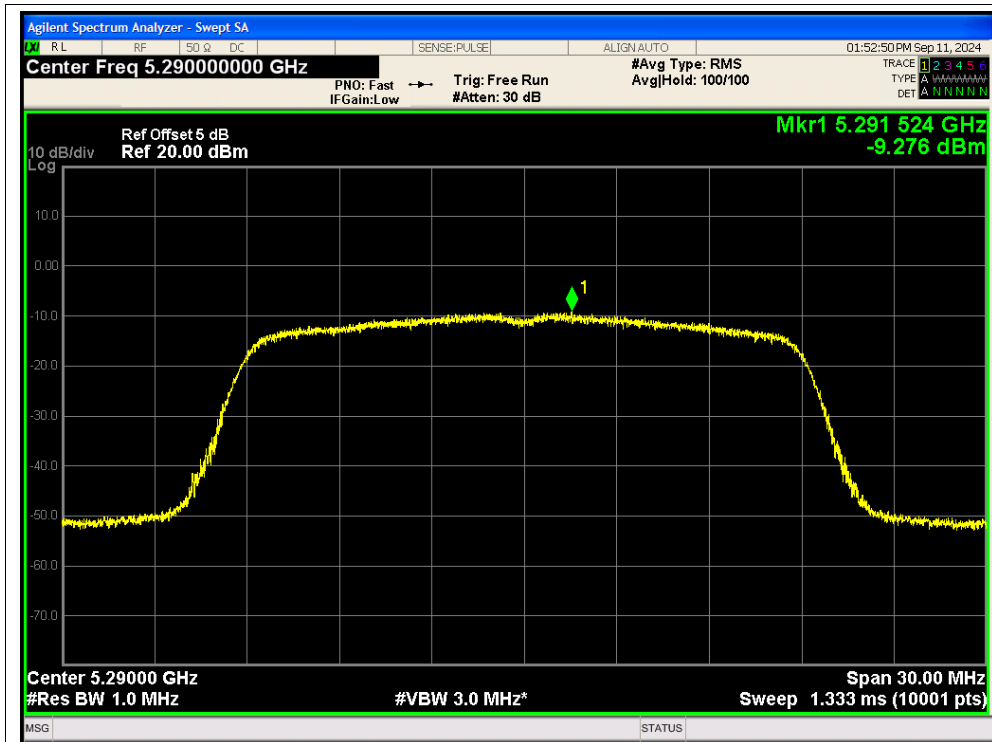


PSD NVNT ac20 5290MHz Ant2

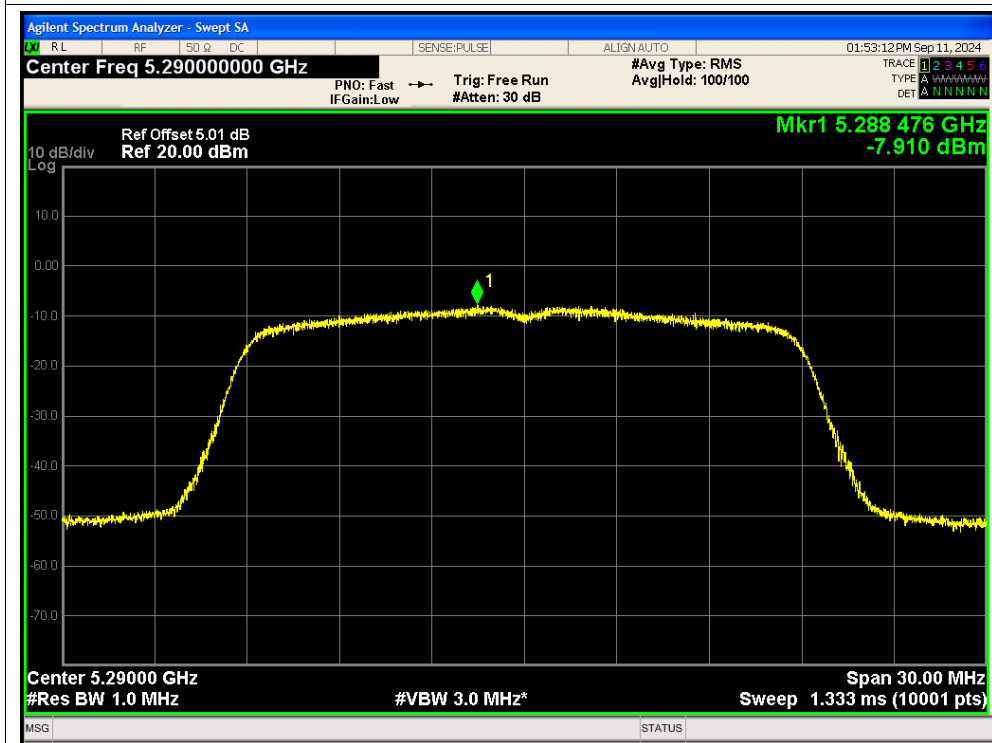


PSD NVNT ac20 5320MHz Ant1

Report

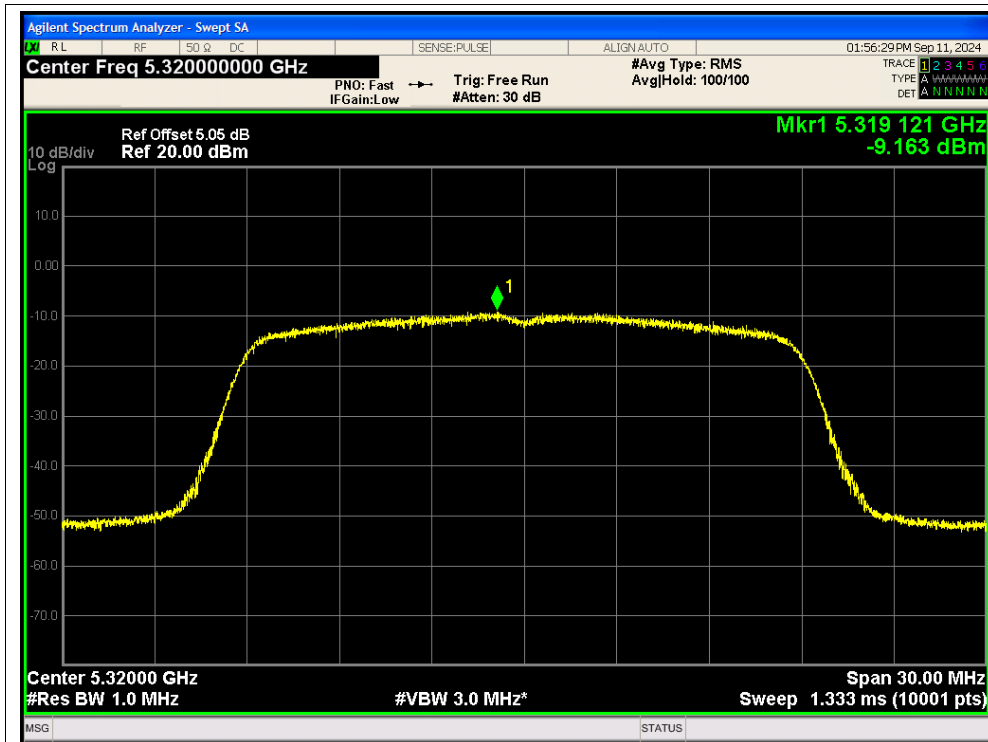


PSD NVNT ac20 5320MHz Ant2

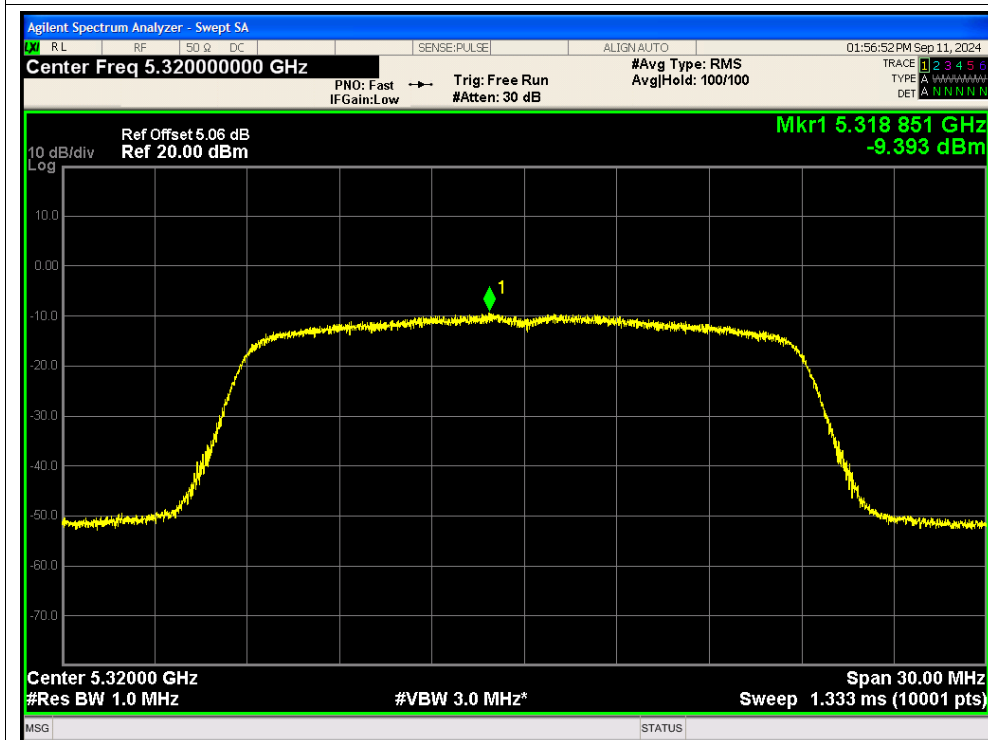


PSD NVNT ac20 5500MHz Ant1

Report

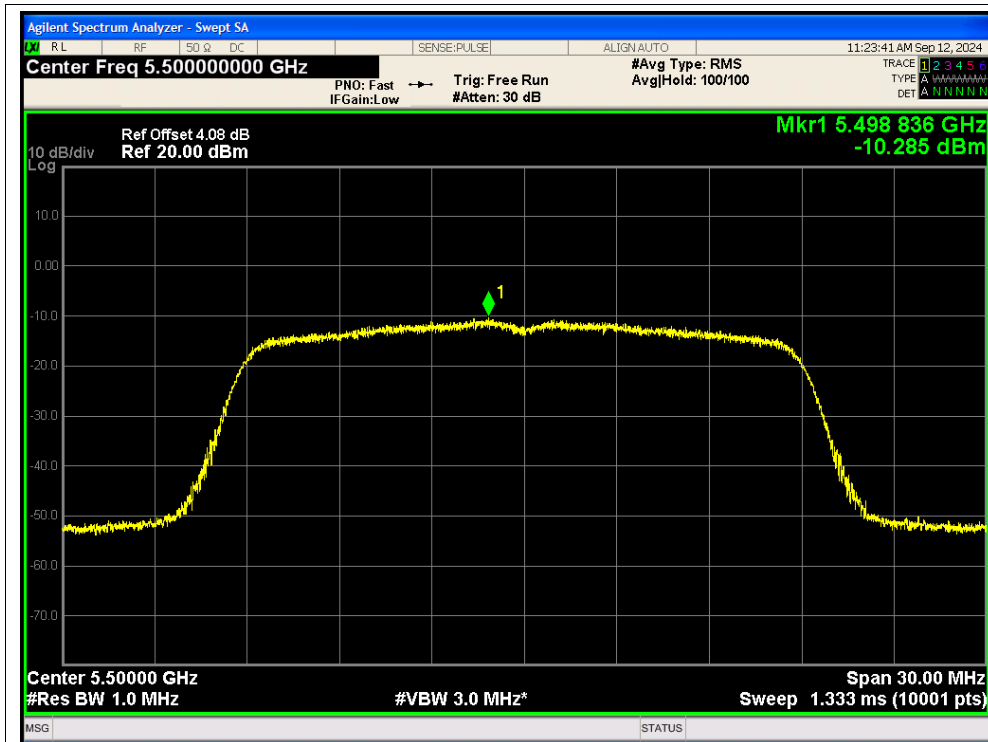


PSD NVNT ac20 5500MHz Ant2

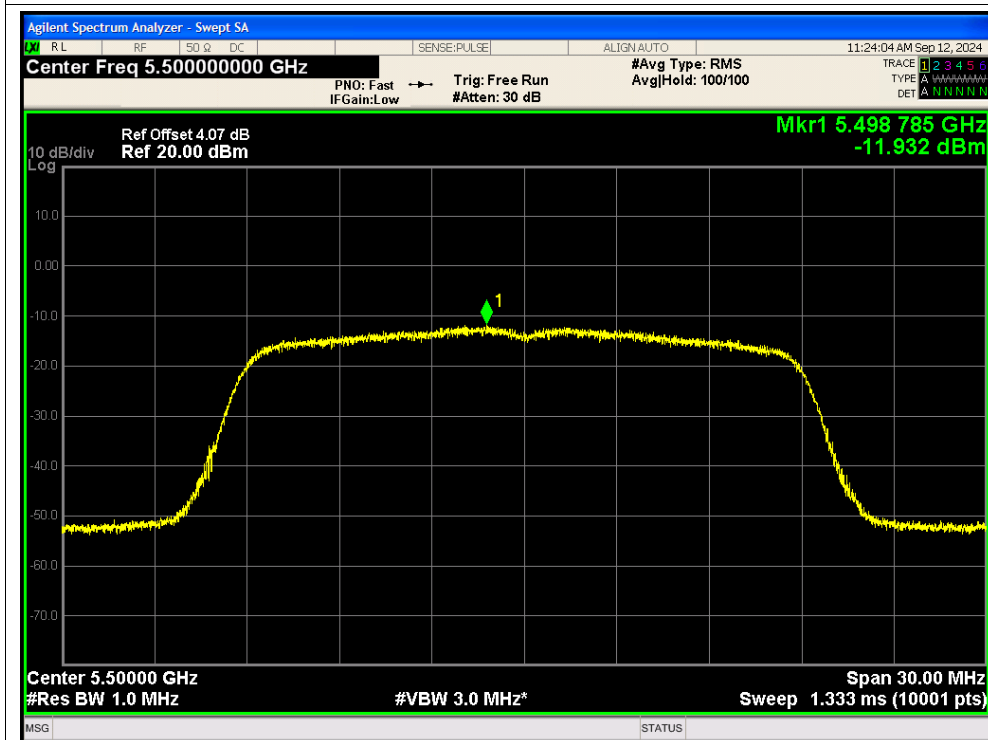


PSD NVNT ac20 5600MHz Ant1

Report

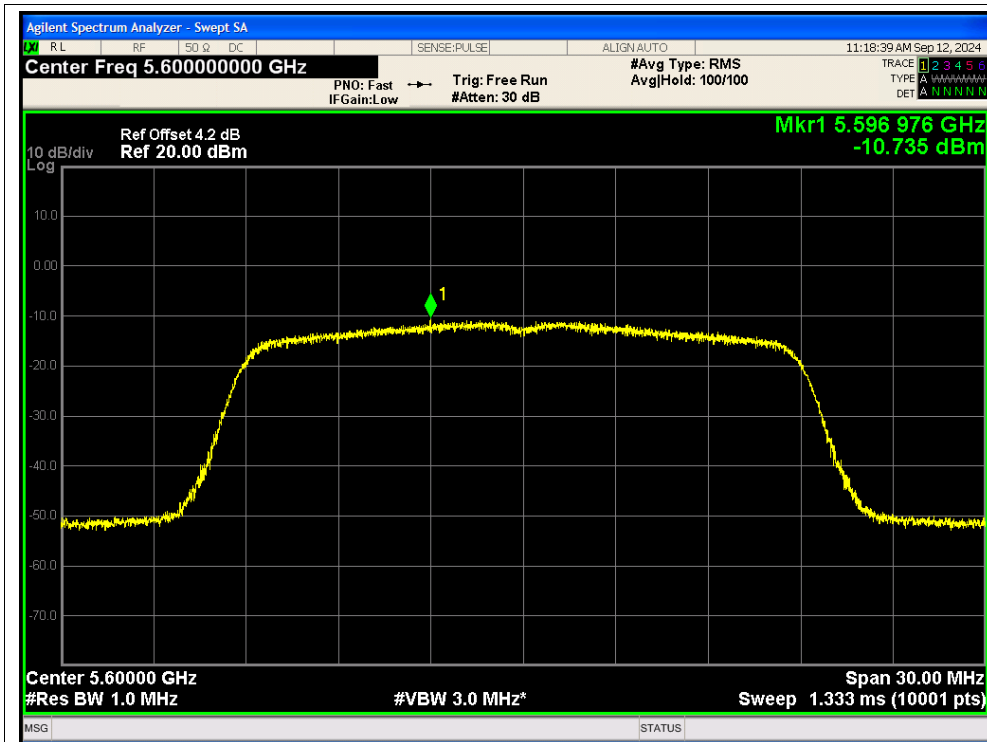


PSD NVNT ac20 5600MHz Ant2

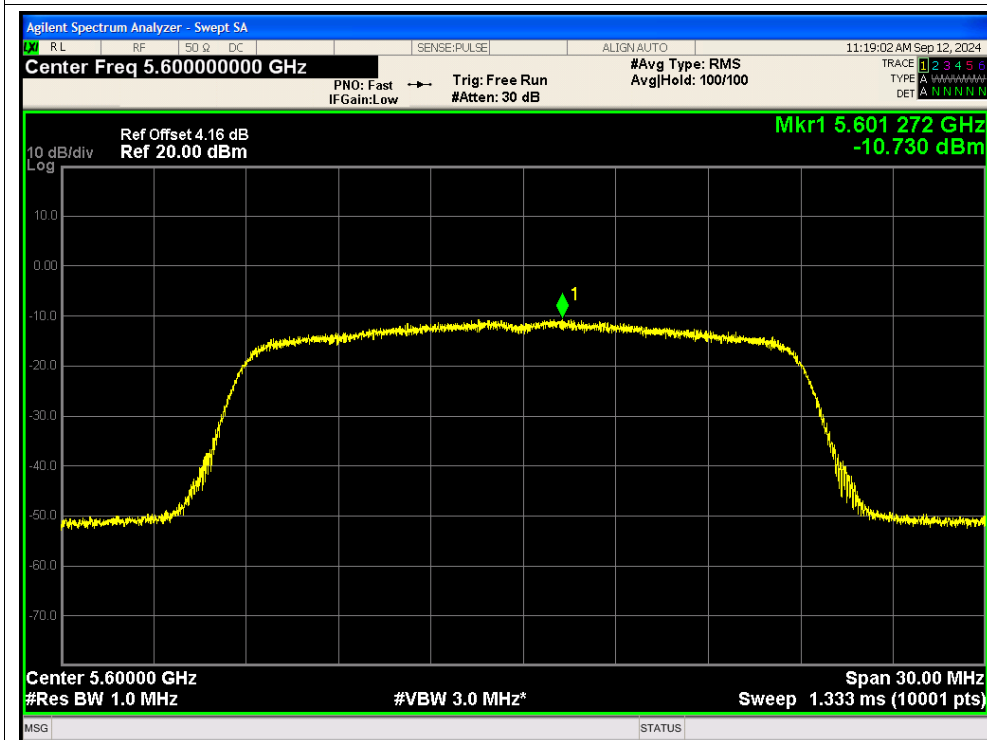


PSD NVNT ac20 5700MHz Ant1

Report

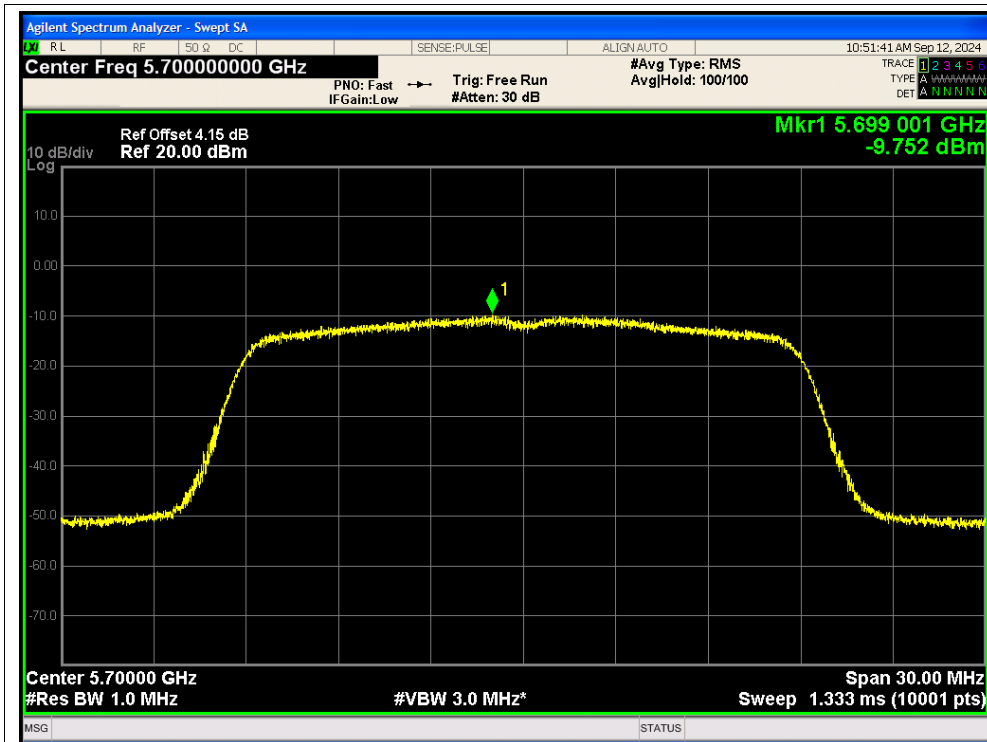


PSD NVNT ac20 5700MHz Ant2

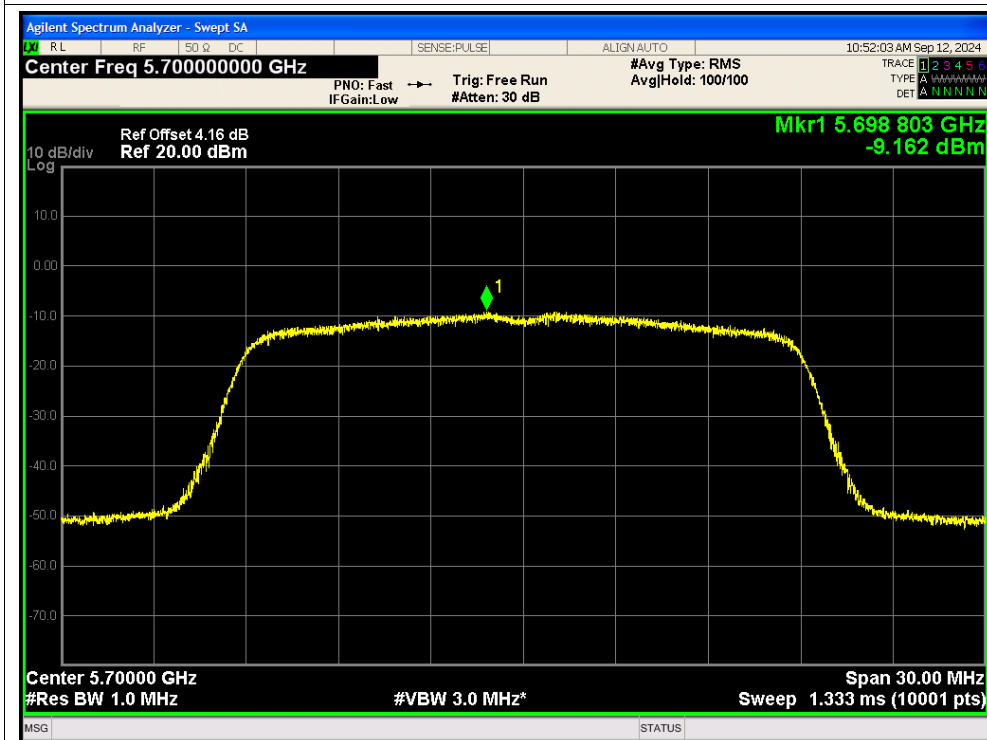


PSD NVNT ac20 5745MHz Ant1


Report

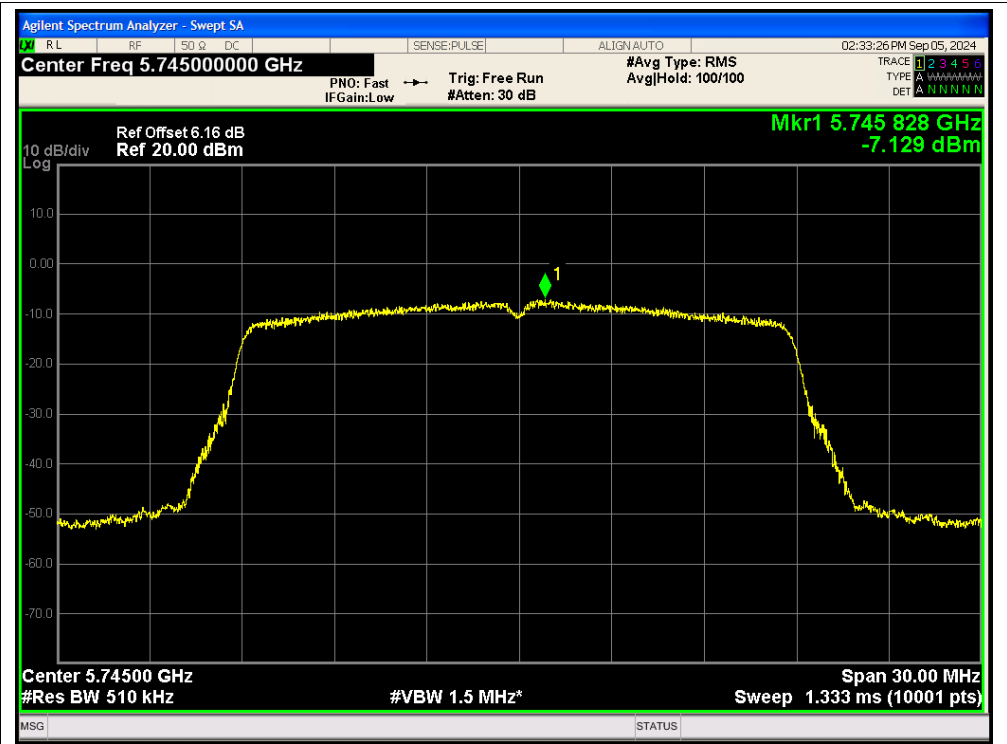


PSD NVNT ac20 5745MHz Ant2

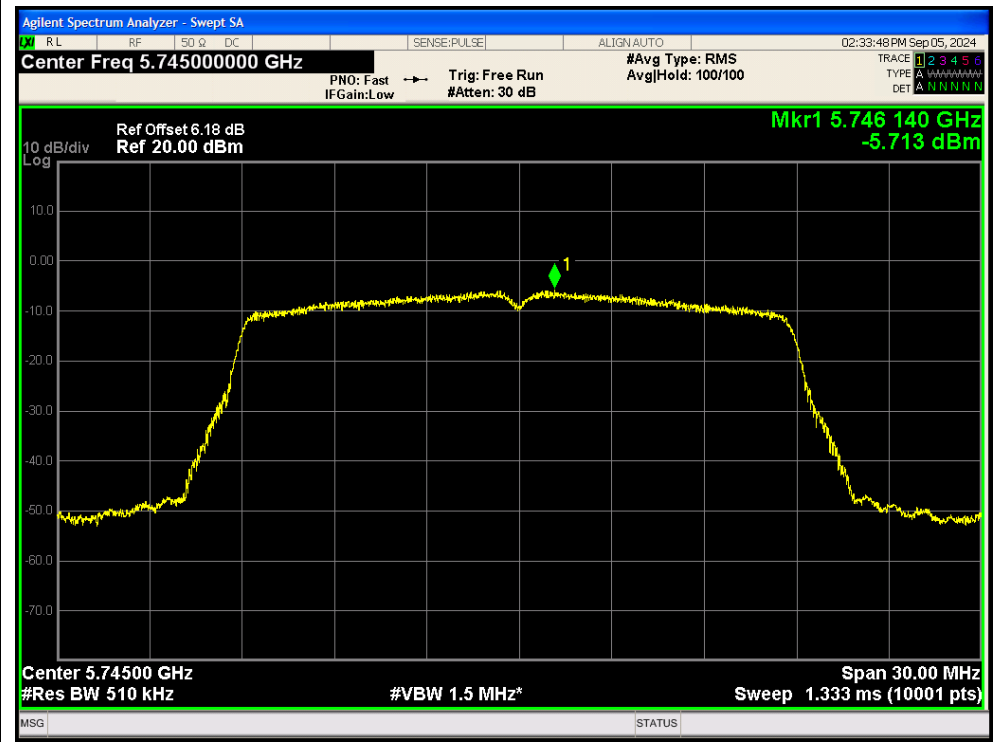

PSD NVNT ac20 5785MHz Ant1

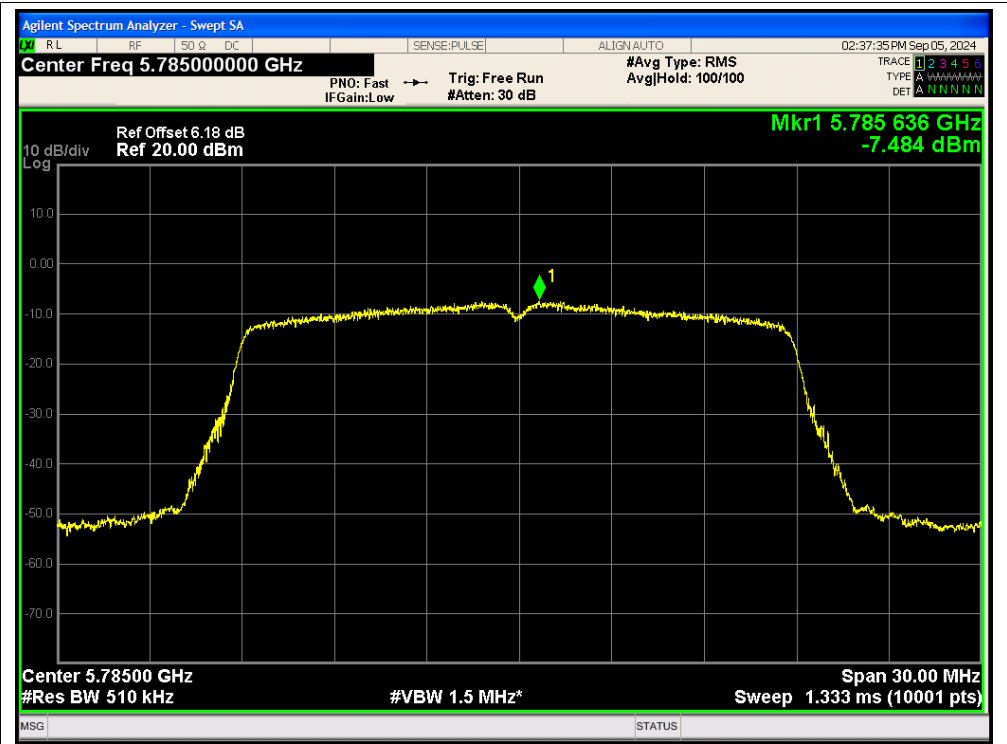


PSD NVNT ac20 5785MHz Ant2

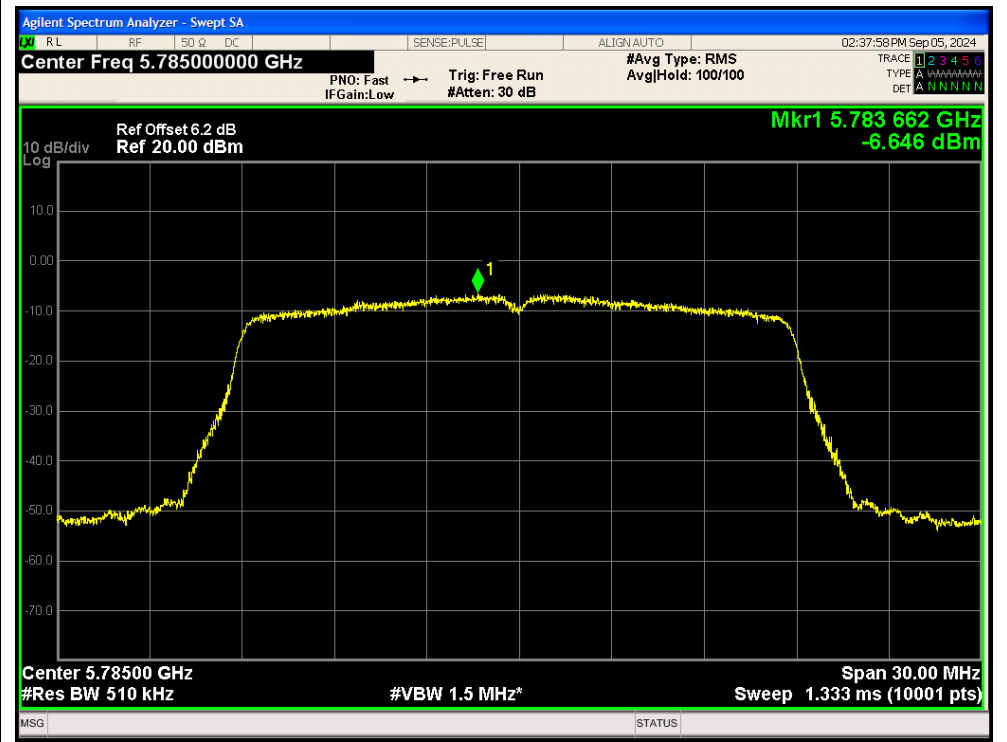


PSD NVNT ac20 5825MHz Ant1

Report

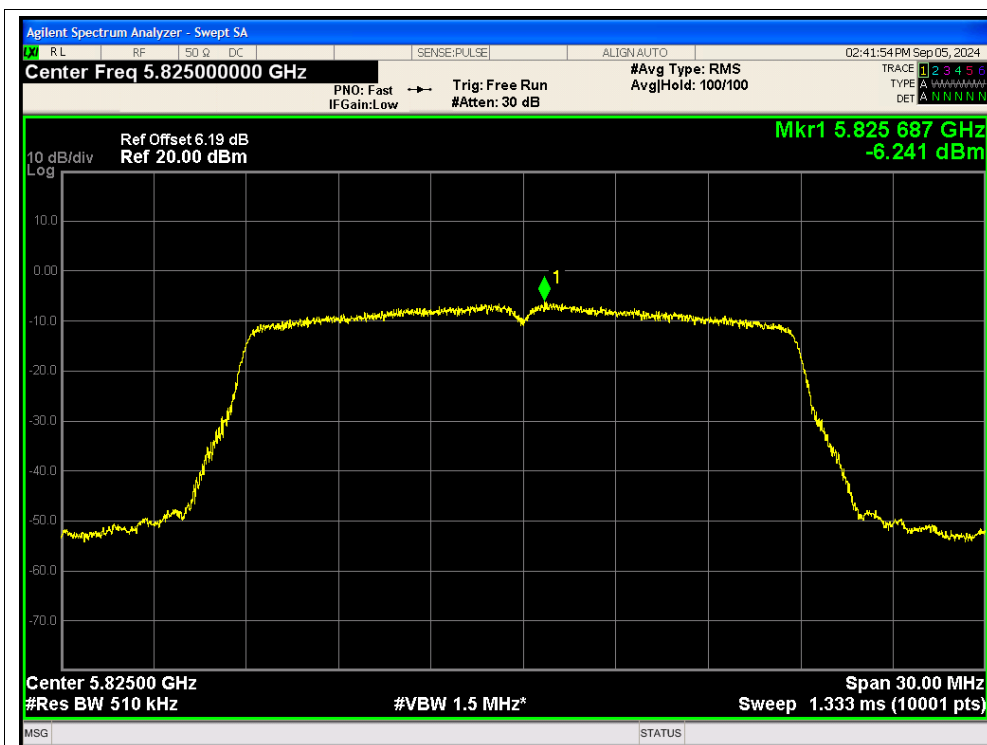


PSD NVNT ac20 5825MHz Ant2

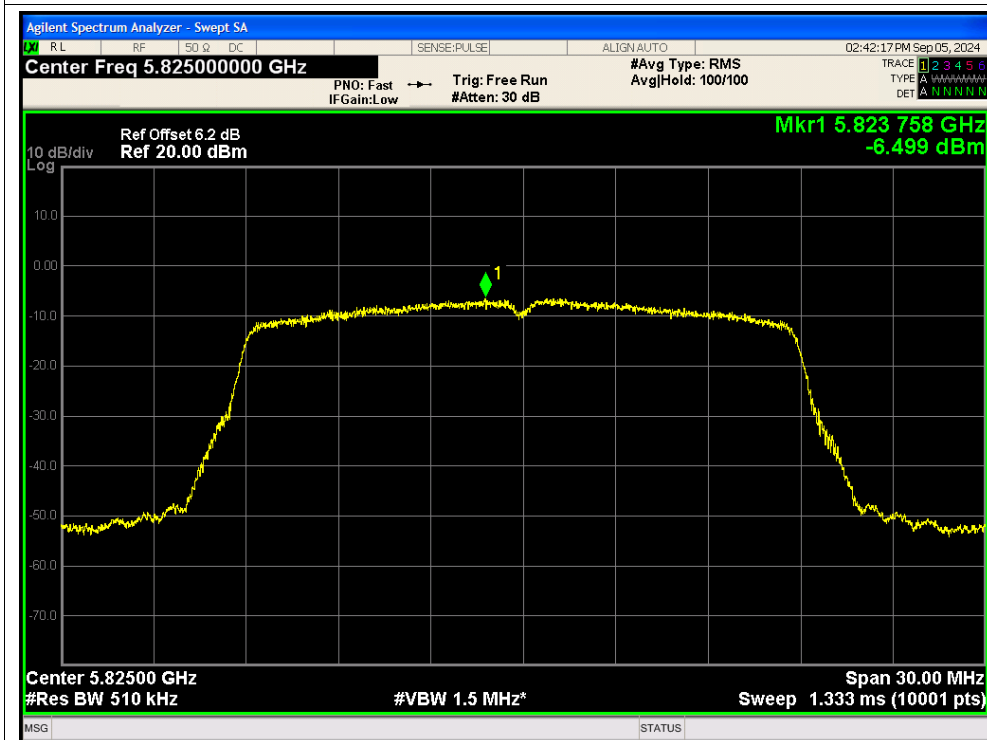


PSD NVNT ac40 5190MHz Ant1

Report

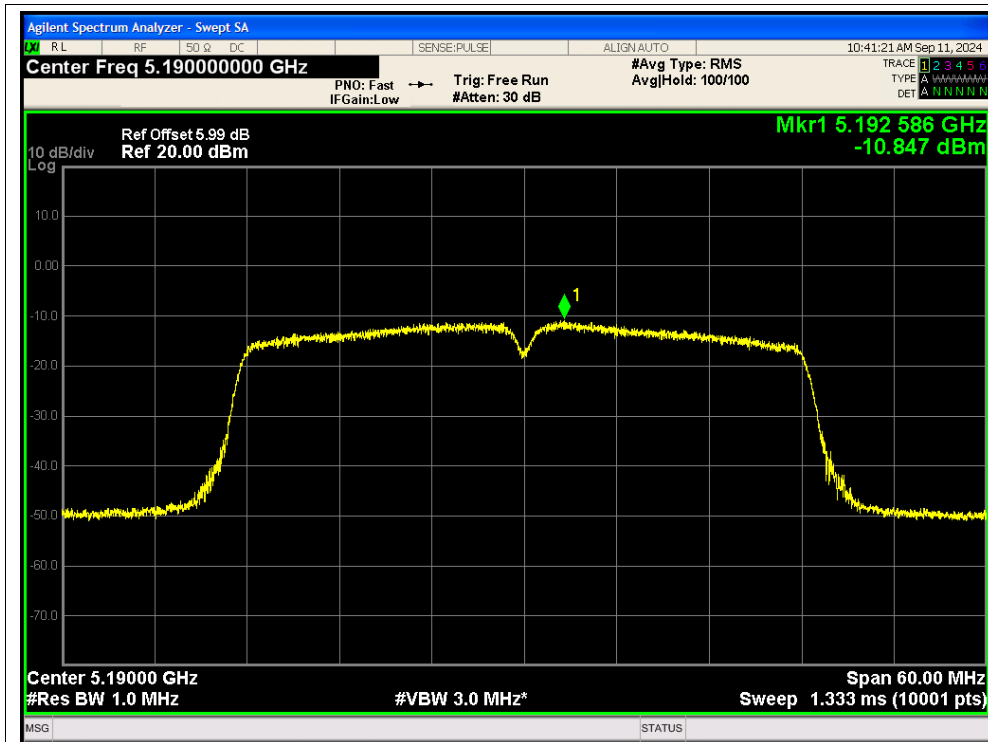


PSD NVNT ac40 5190MHz Ant2

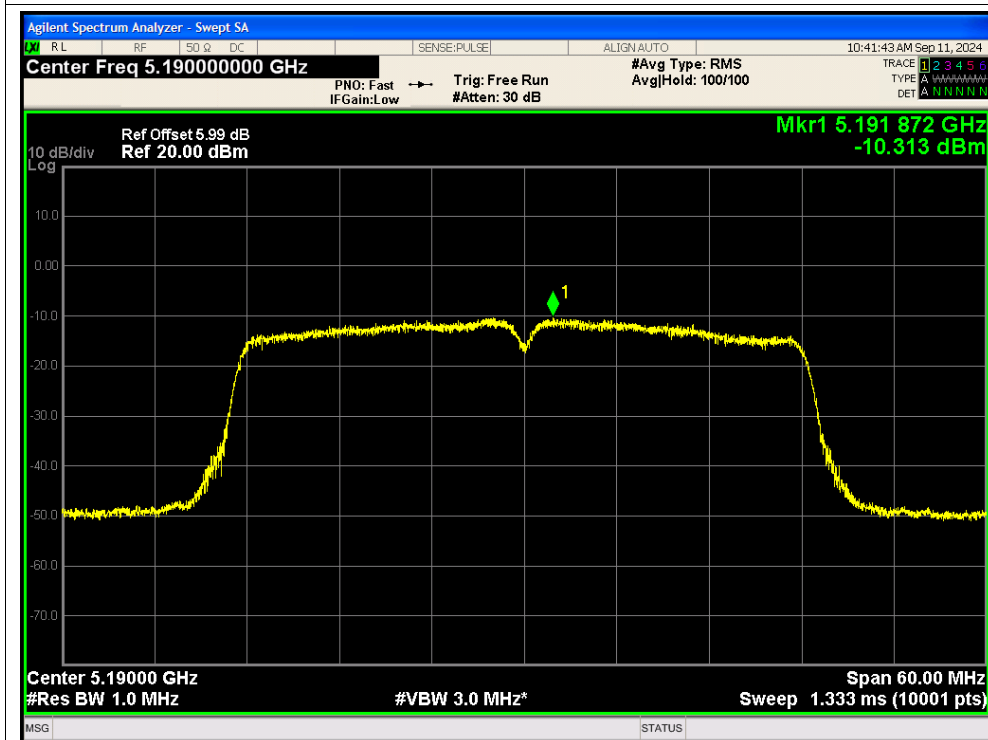


PSD NVNT ac40 5210MHz Ant1

Report

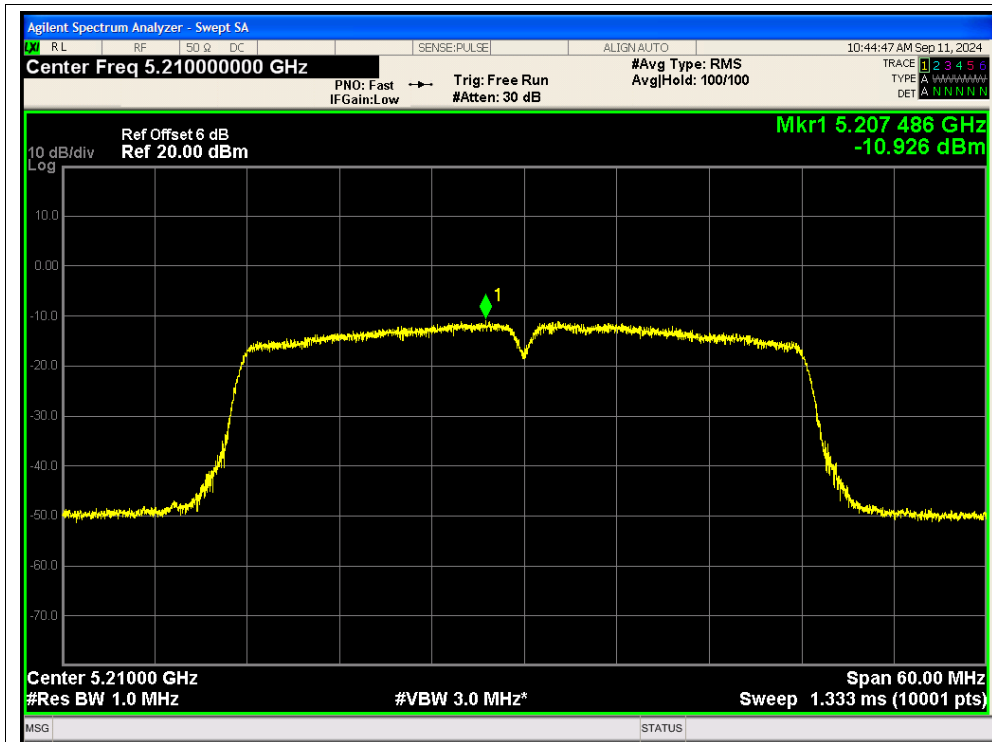


PSD NVNT ac40 5210MHz Ant2

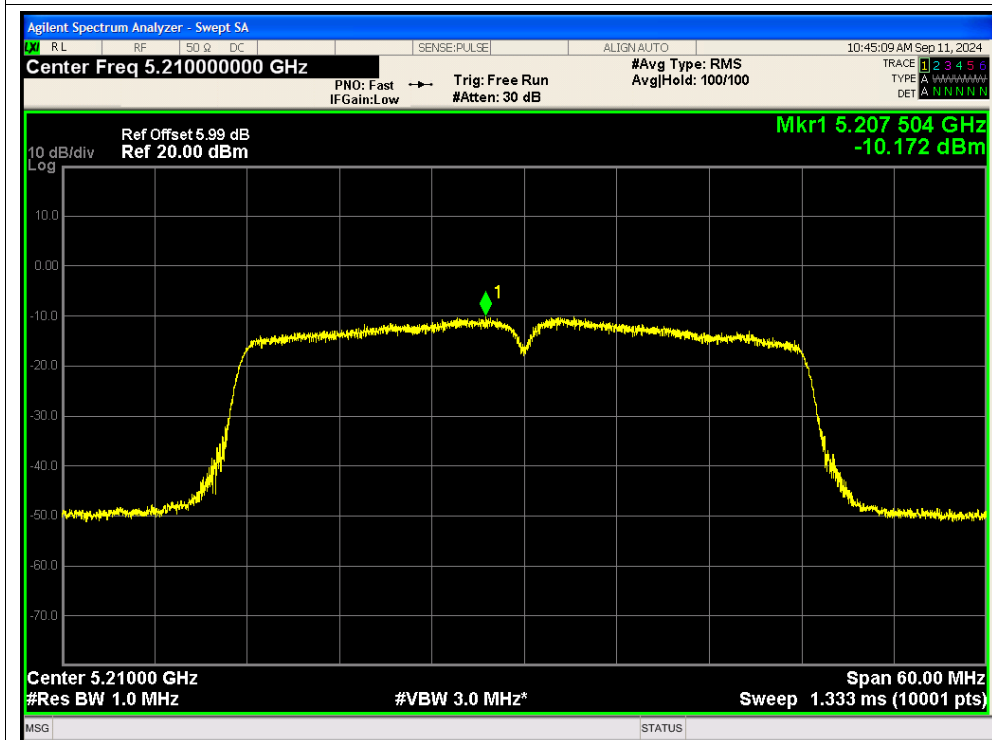


PSD NVNT ac40 5230MHz Ant1

Report

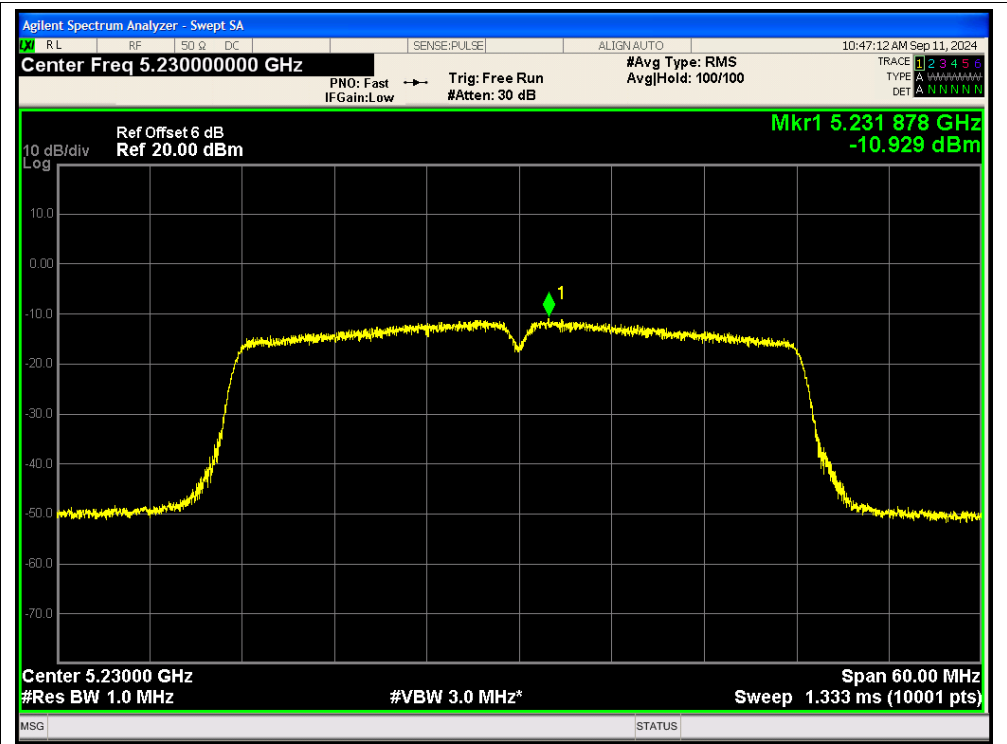


PSD NVNT ac40 5230MHz Ant2

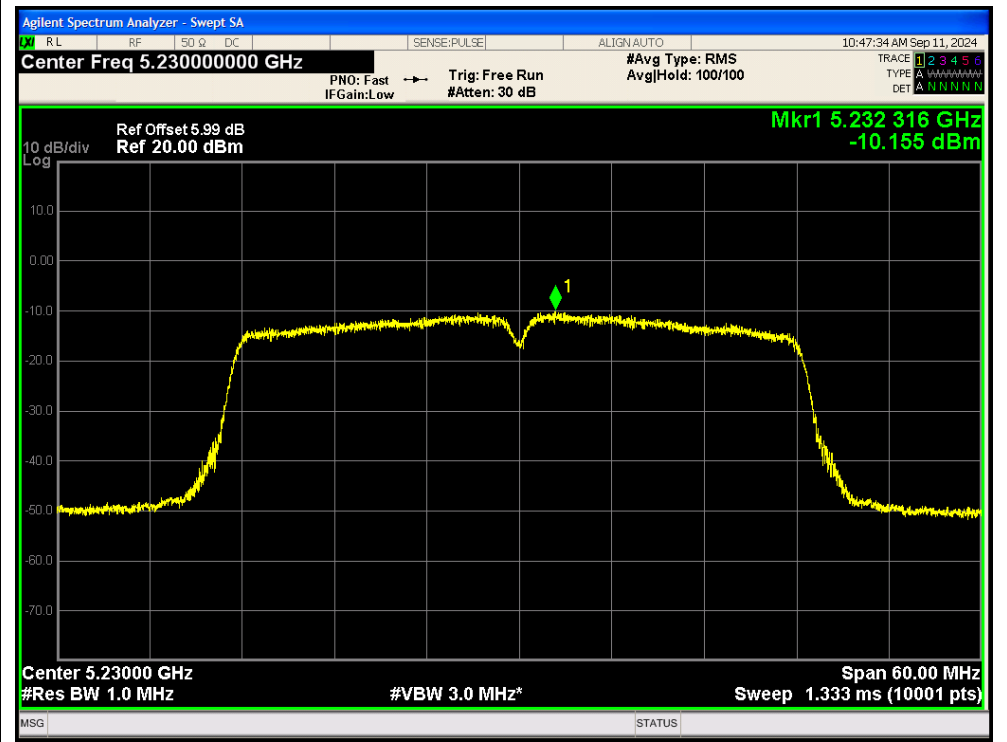


PSD NVNT ac40 5270MHz Ant1

Report

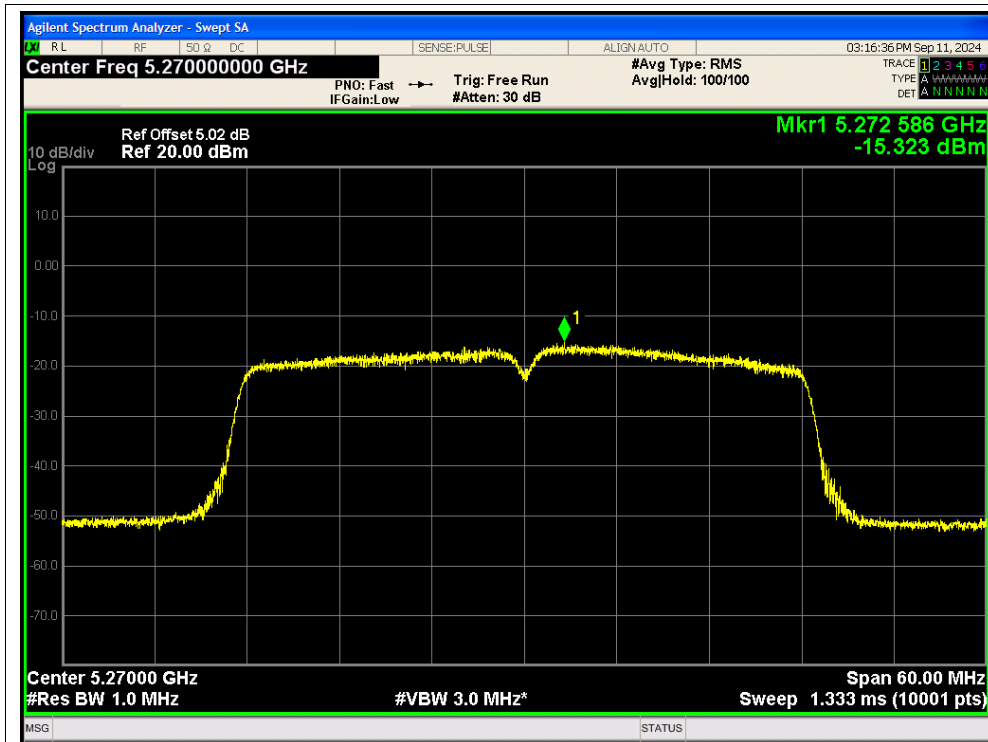

PSD NVNT ac40 5270MHz Ant2

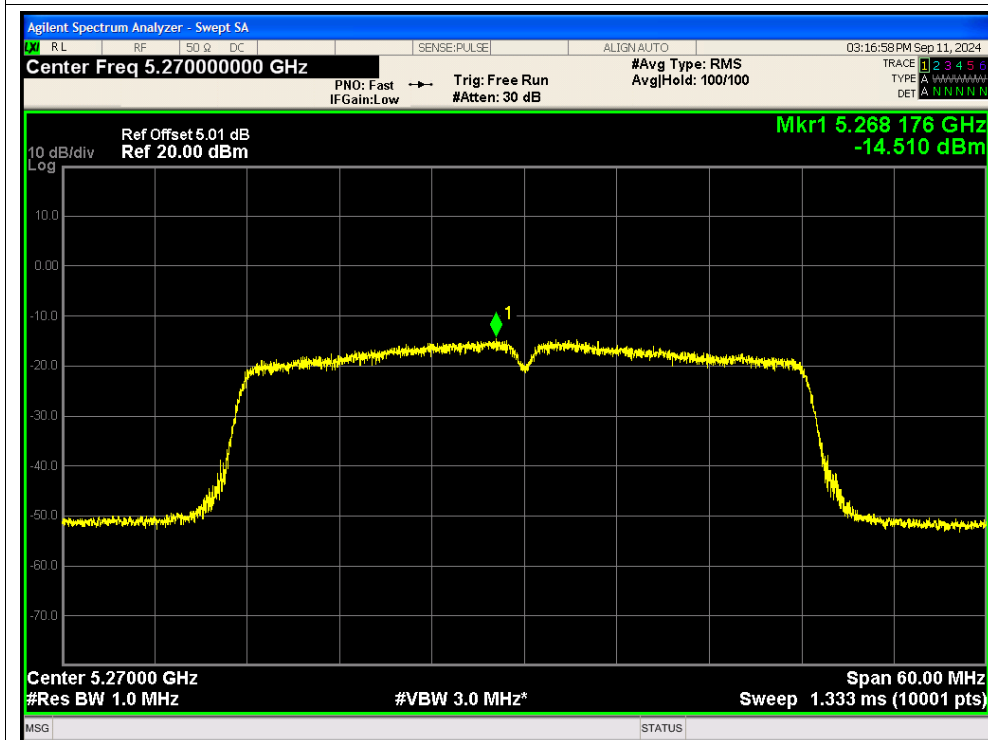


PSD NVNT ac40 5290MHz Ant1

Report




PSD NVNT ac40 5290MHz Ant2

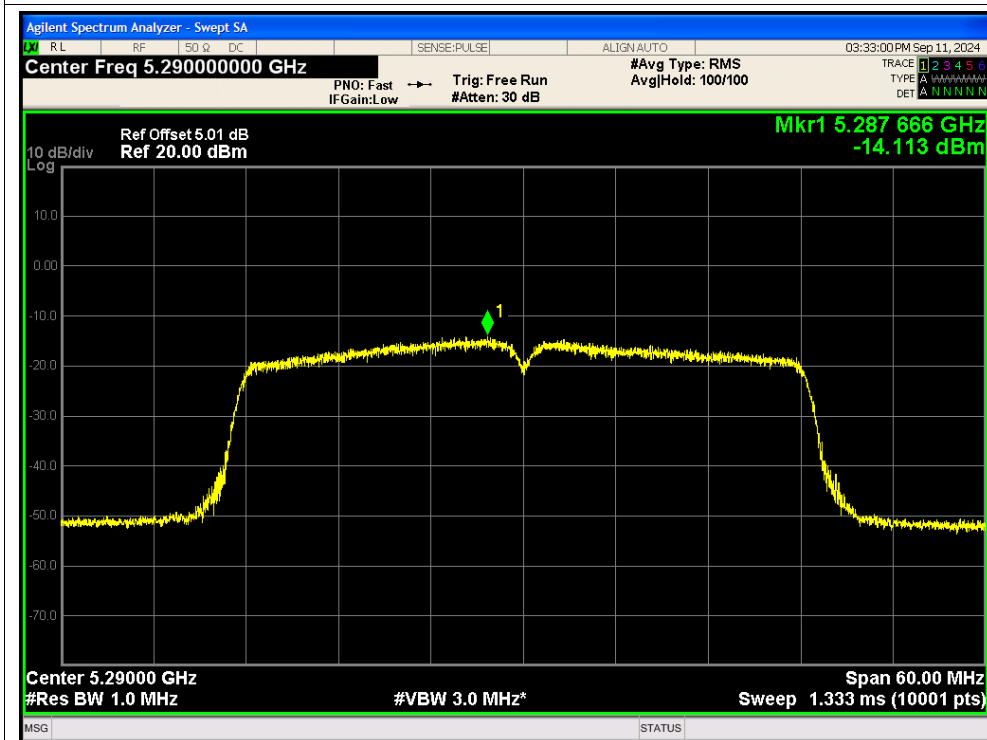


PSD NVNT ac40 5310MHz Ant1

Report

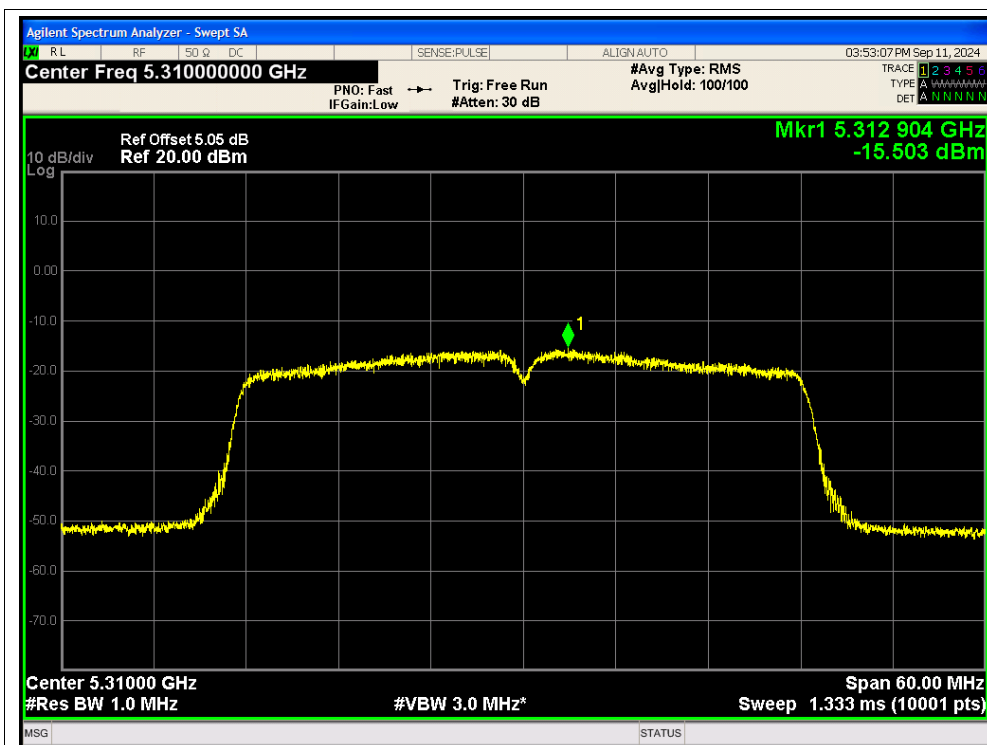


PSD NVNT ac40 5310MHz Ant2

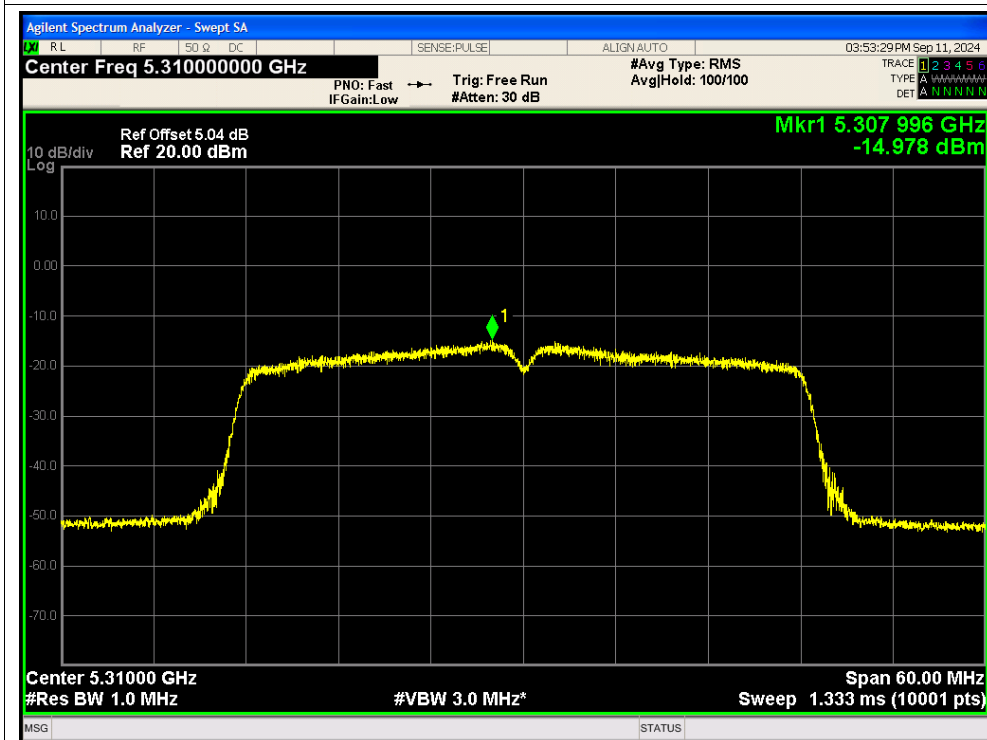


PSD NVNT ac40 5510MHz Ant1

Report

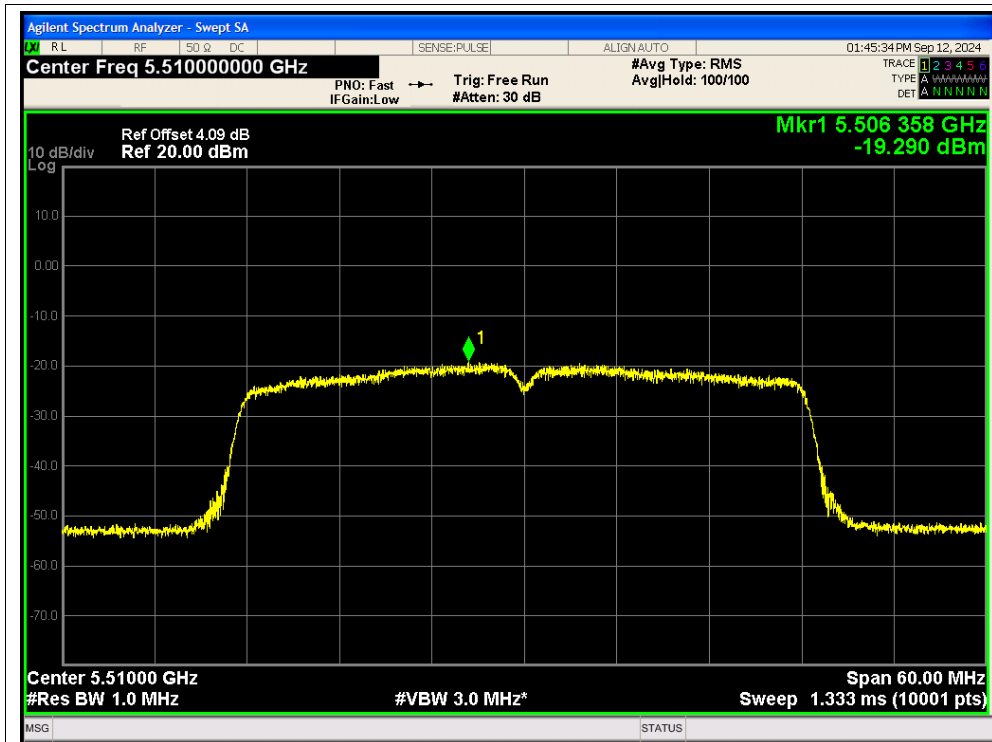


PSD NVNT ac40 5510MHz Ant2

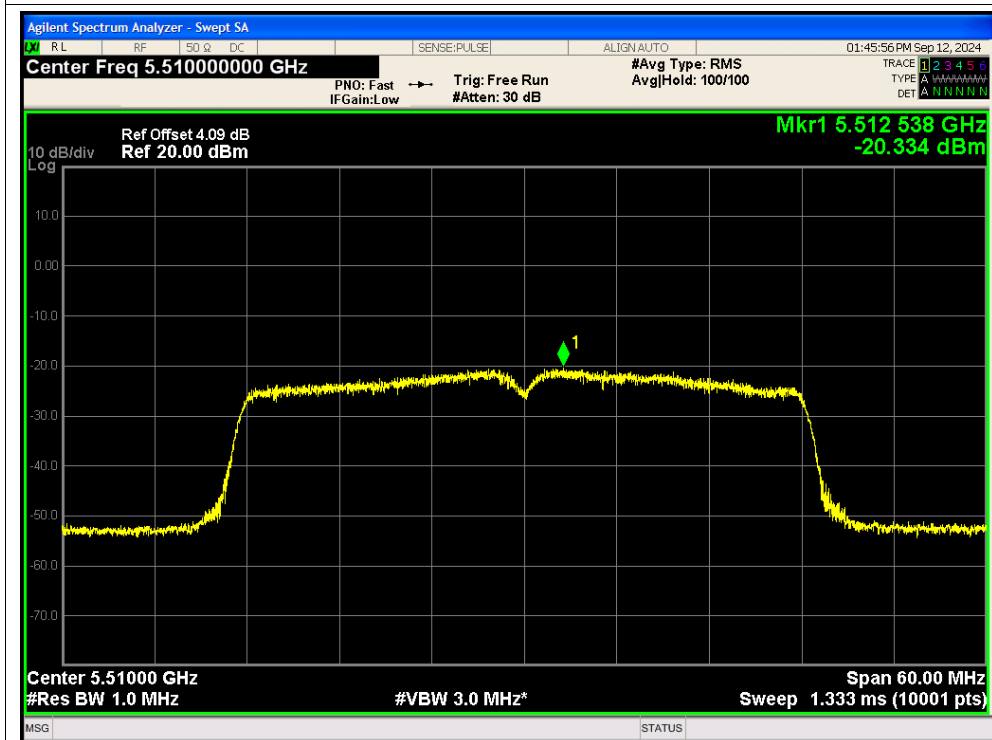


PSD NVNT ac40 5600MHz Ant1

Report

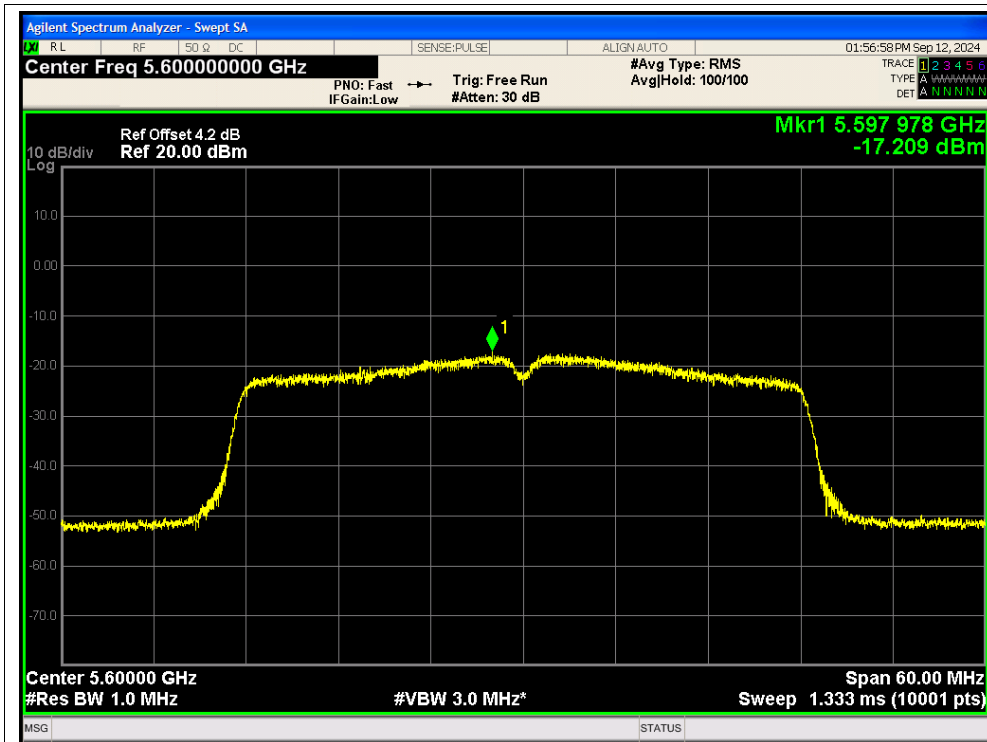


PSD NVNT ac40 5600MHz Ant2

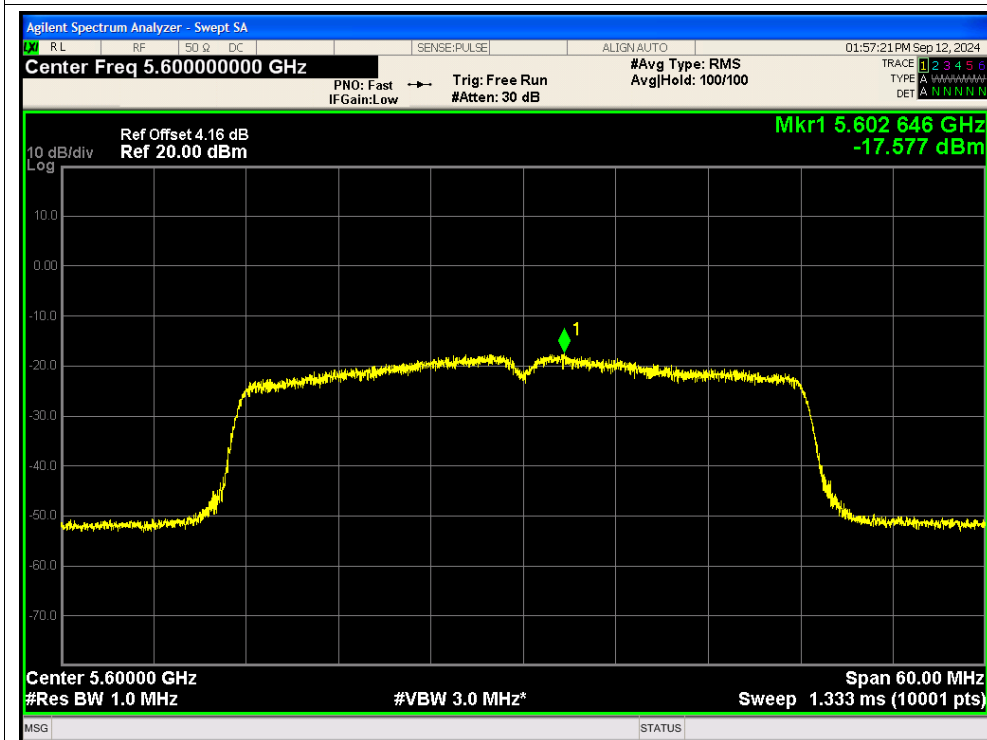


PSD NVNT ac40 5690MHz Ant1

Report

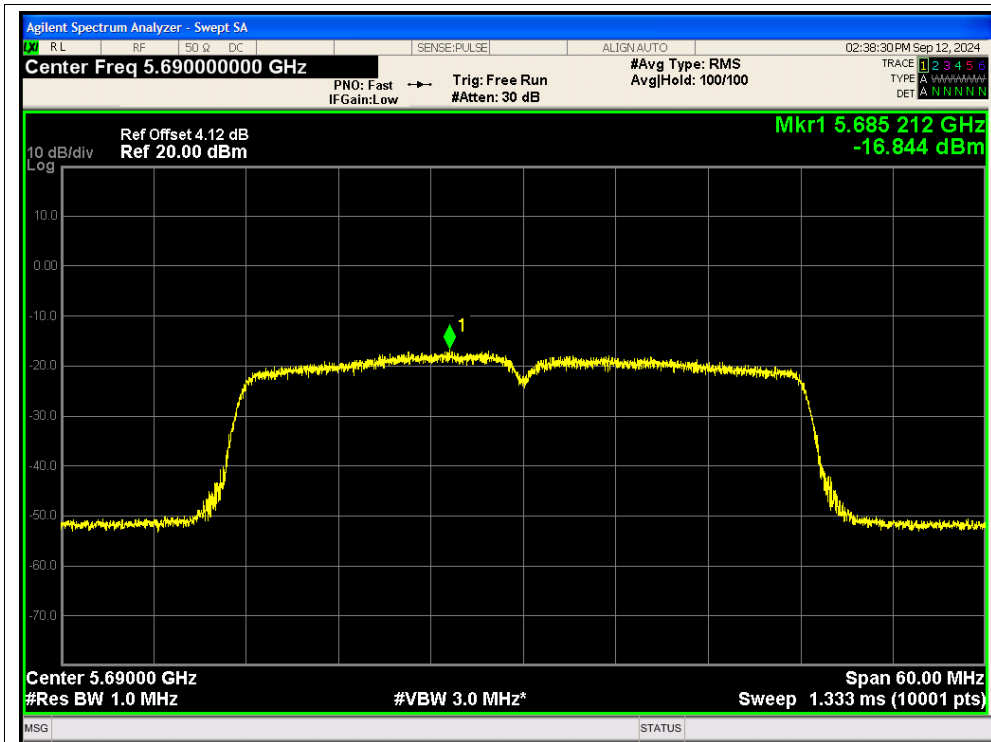


PSD NVNT ac40 5690MHz Ant2

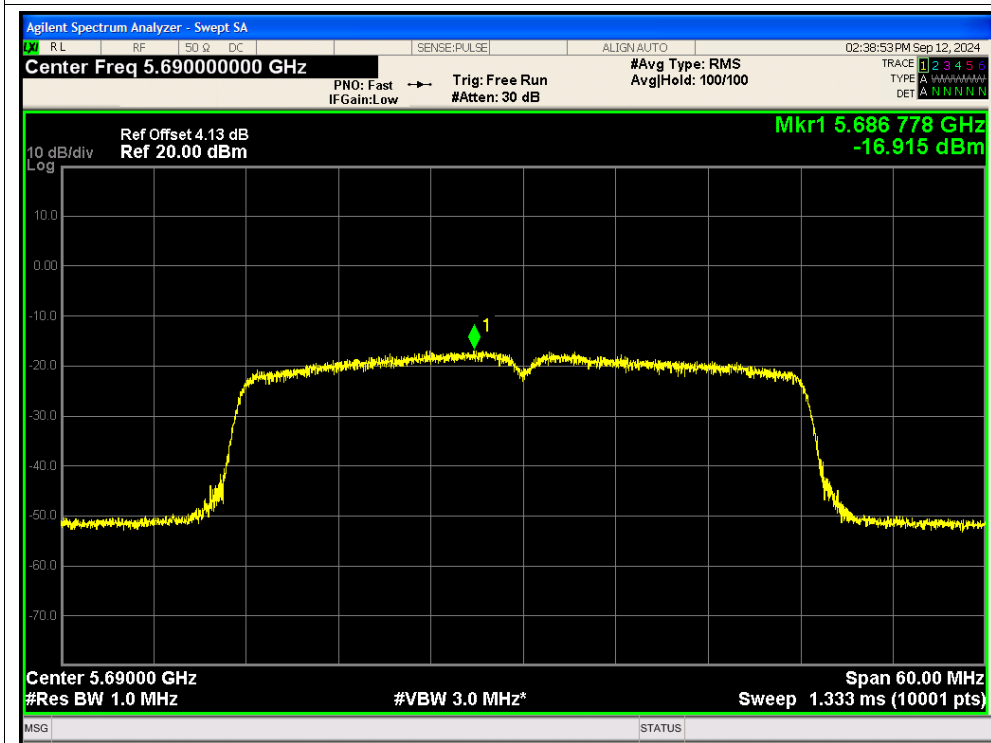


PSD NVNT ac40 5755MHz Ant1

Report

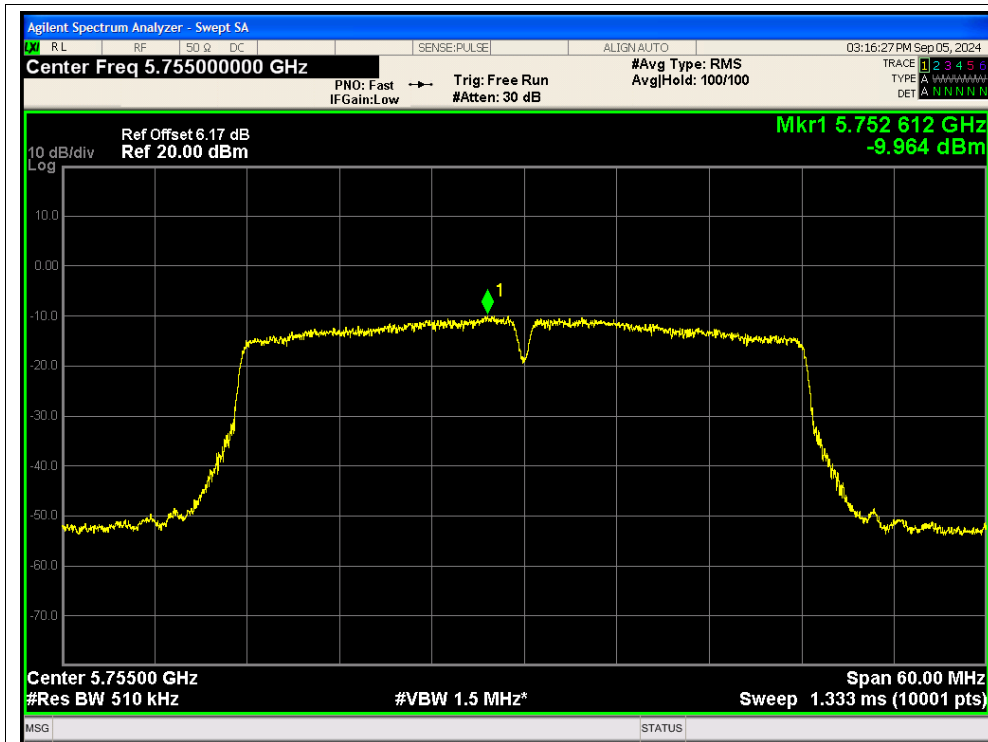

PSD NVNT ac40 5755MHz Ant2

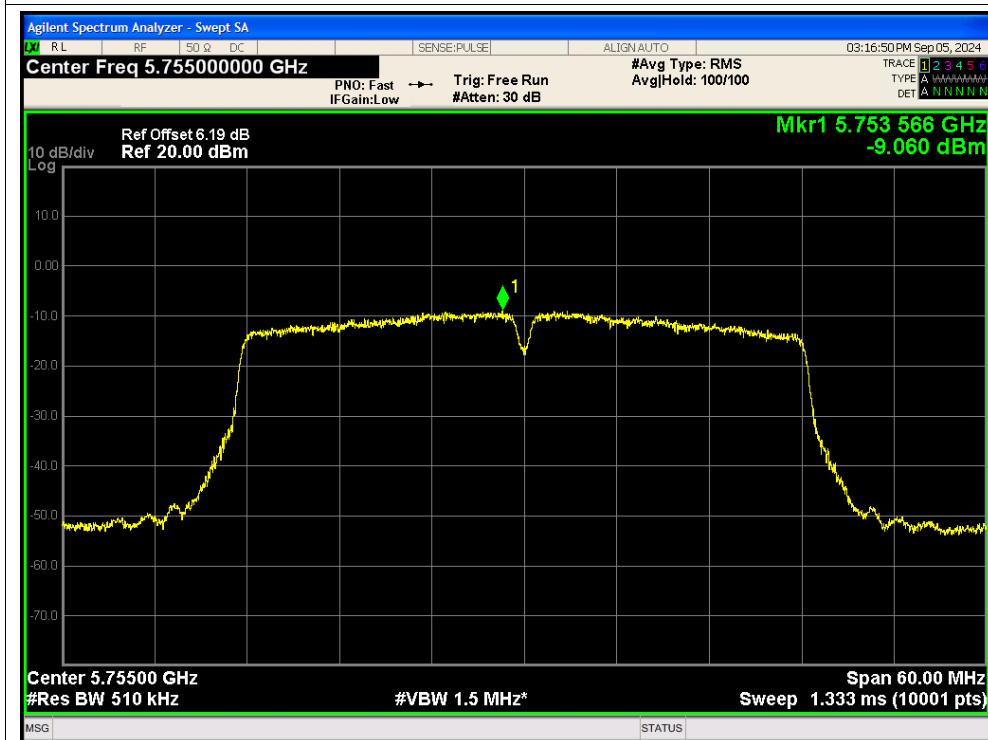


PSD NVNT ac40 5785MHz Ant1

Report




PSD NVNT ac40 5785MHz Ant2

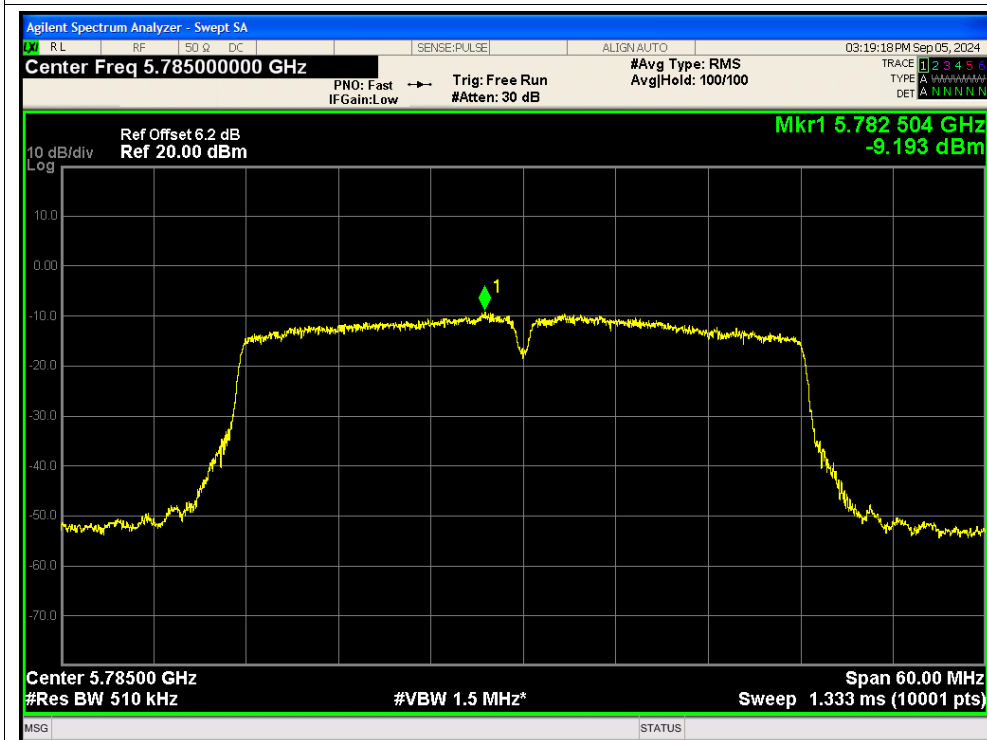


PSD NVNT ac40 5815MHz Ant1

Report

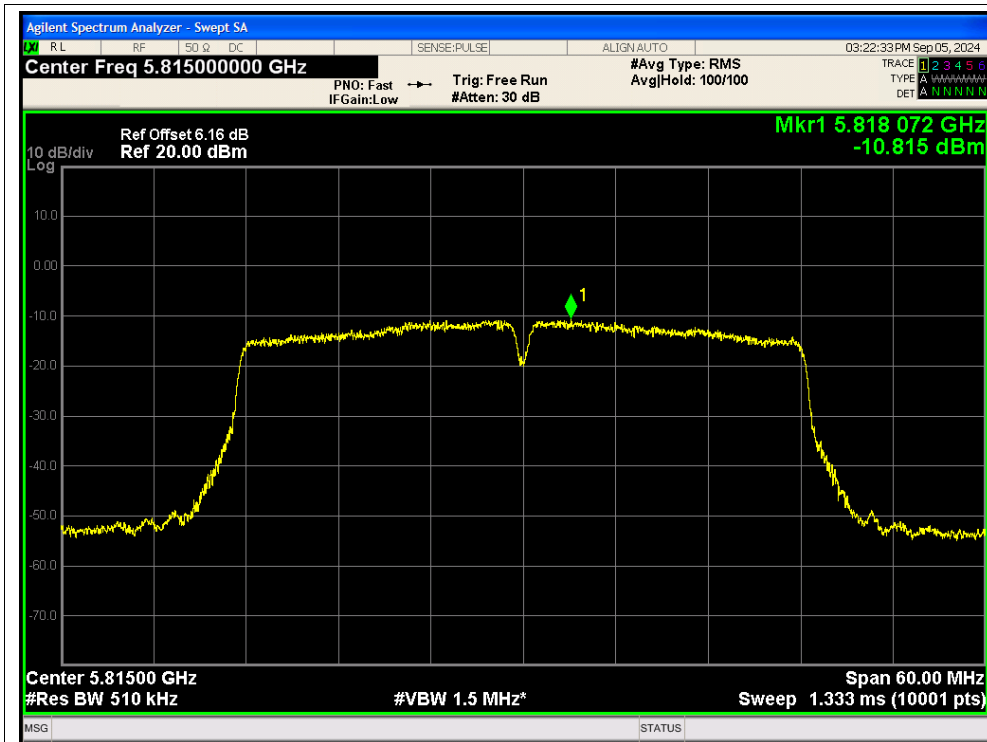

PSD NVNT ac40 5815MHz Ant2

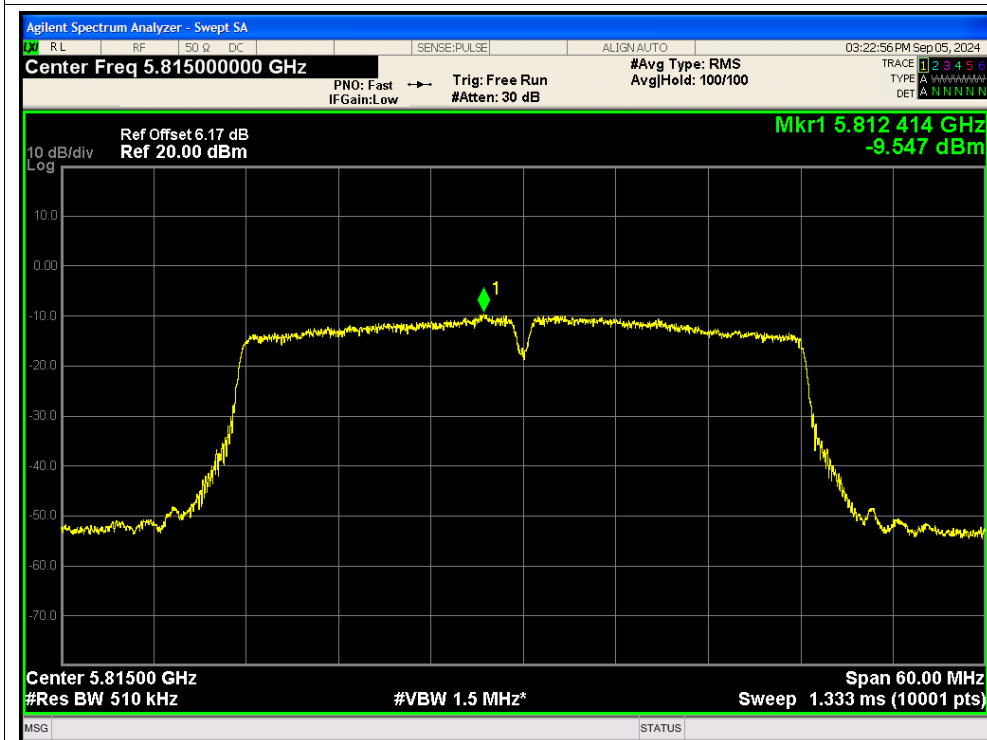

PSD NVNT ac80 5210MHz Ant1

Report




PSD NVNT ac80 5210MHz Ant2




PSD NVNT ac80 5290MHz Ant1

Report

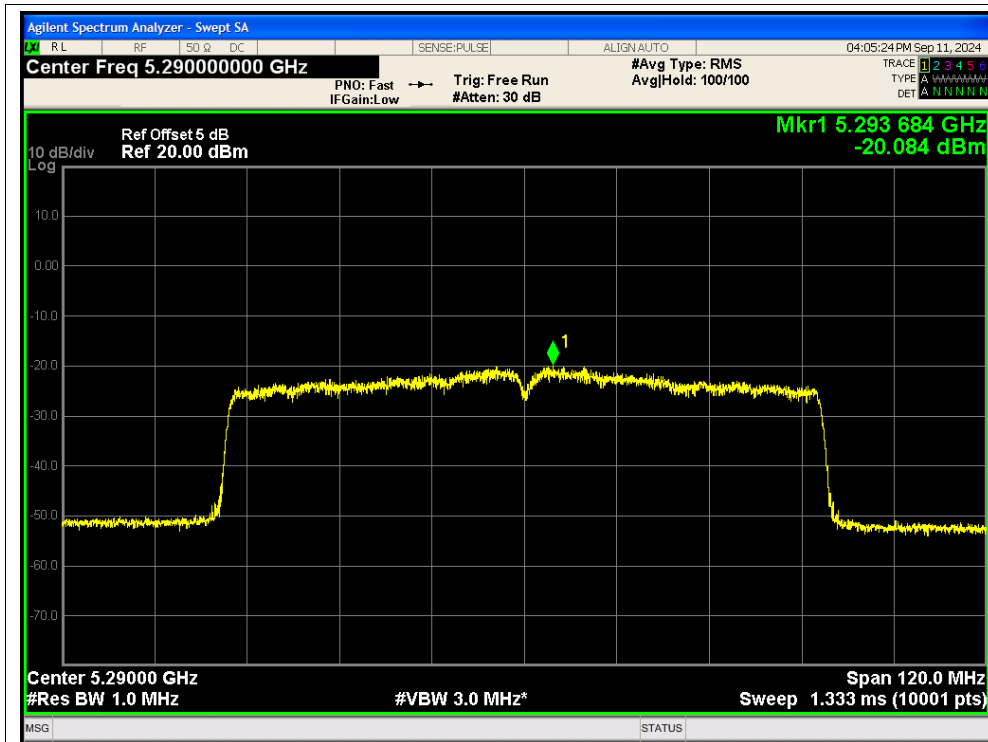

PSD NVNT ac80 5290MHz Ant2

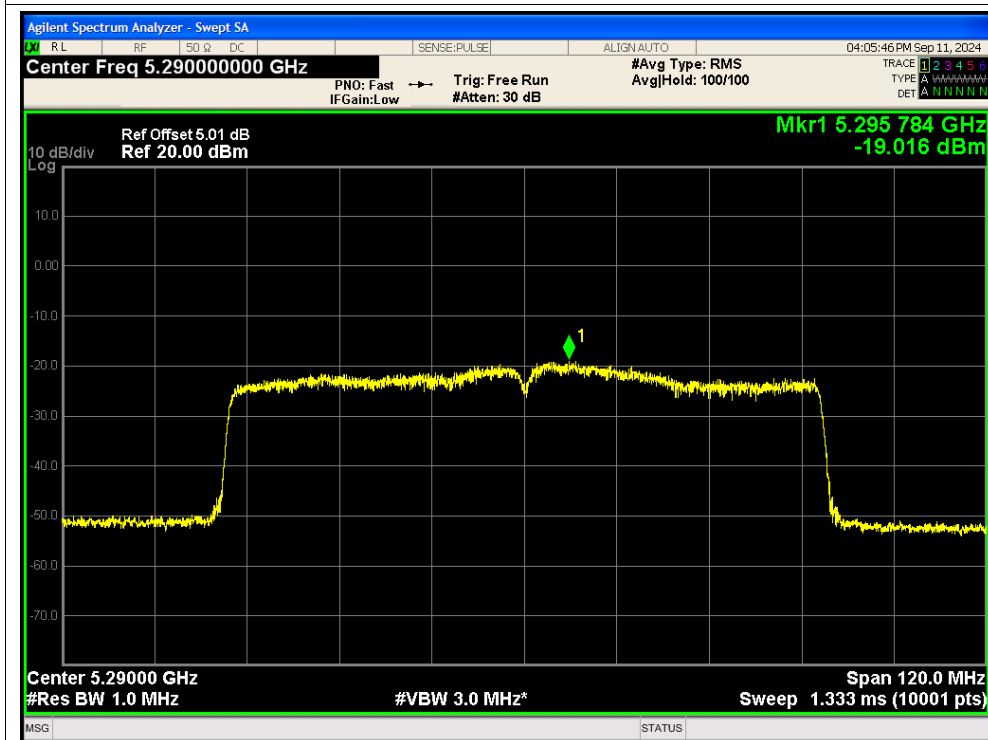


PSD NVNT ac80 5530MHz Ant1

Report



PSD NVNT ac80 5530MHz Ant2

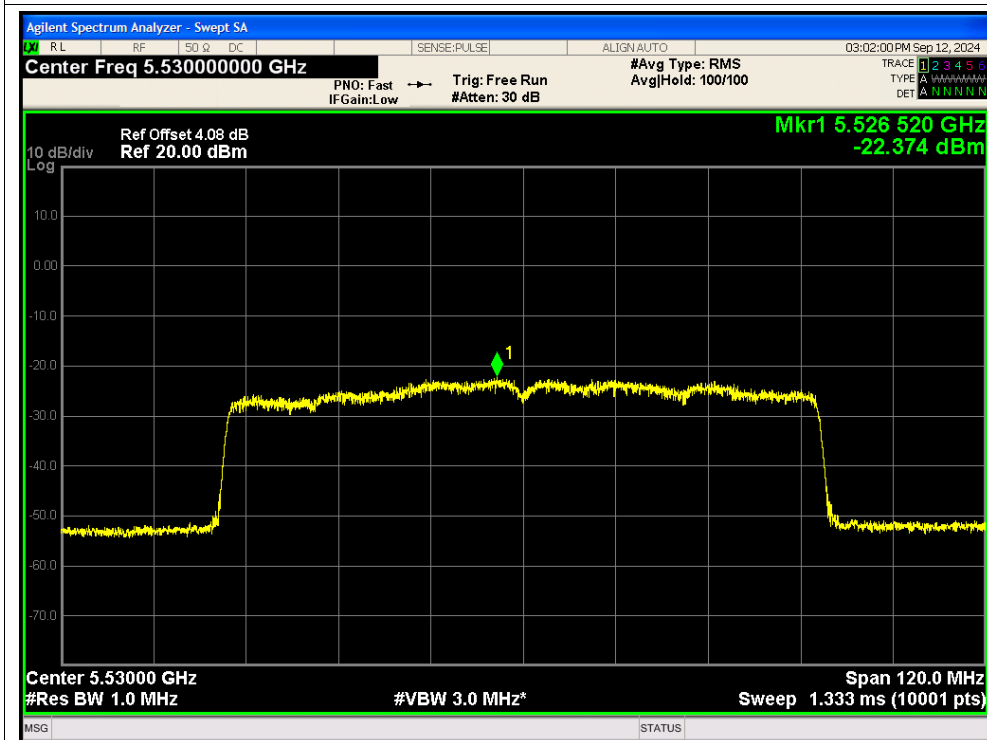


PSD NVNT ac80 5600MHz Ant1

Report




PSD NVNT ac80 5600MHz Ant2

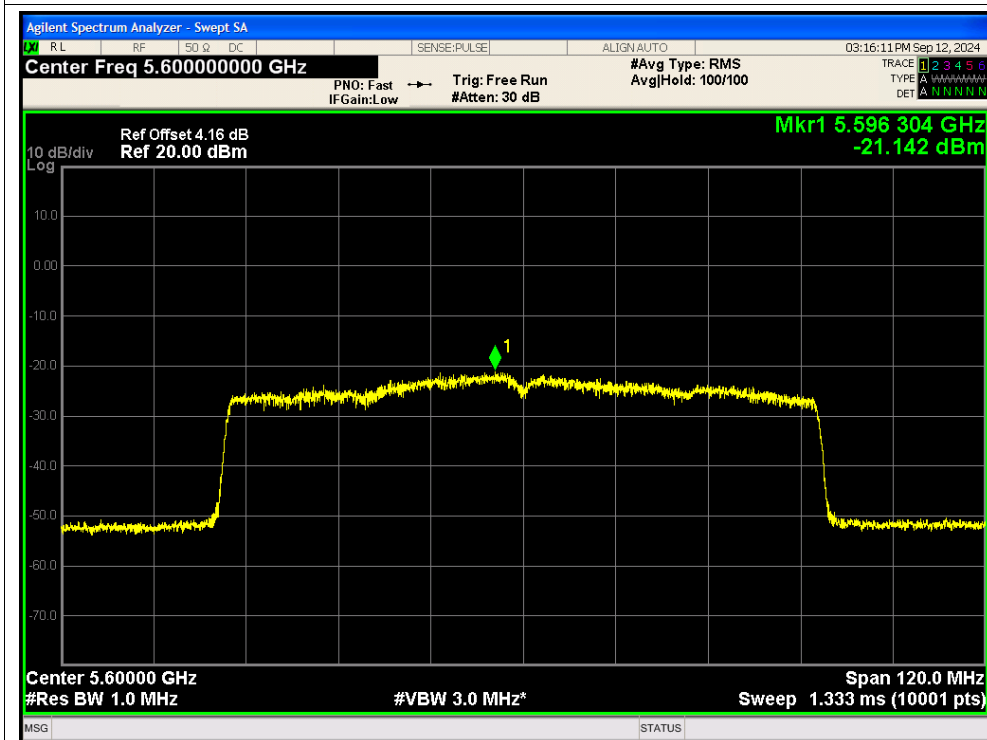

PSD NVNT ac80 5670MHz Ant1




PSD NVNT ac80 5670MHz Ant2

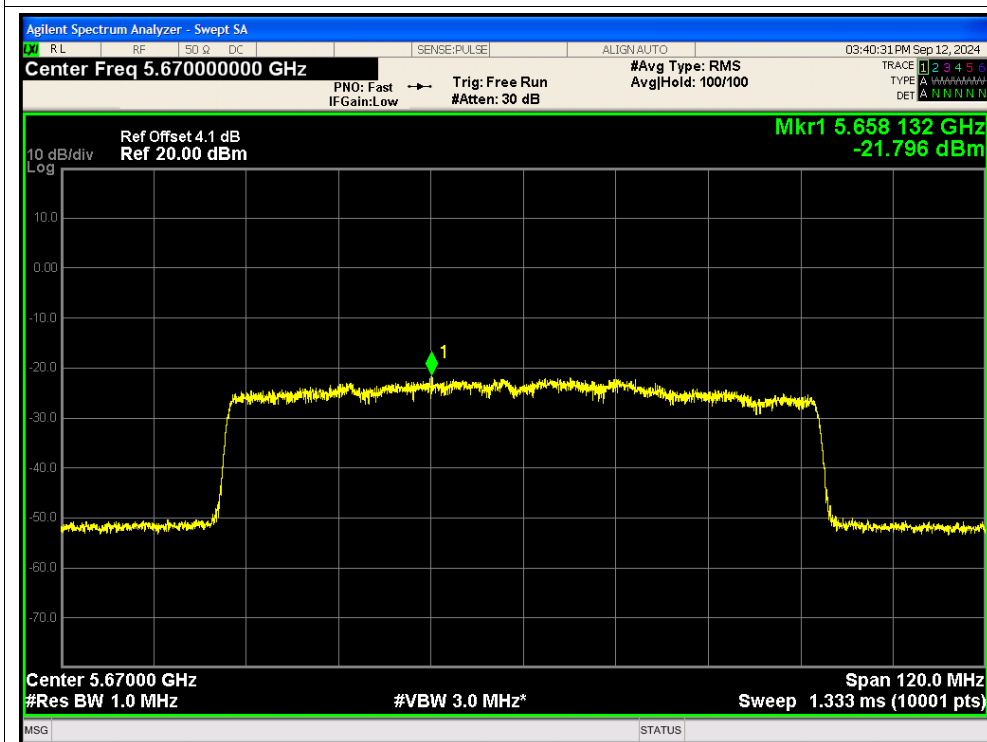


PSD NVNT ac80 5775MHz Ant1

Report

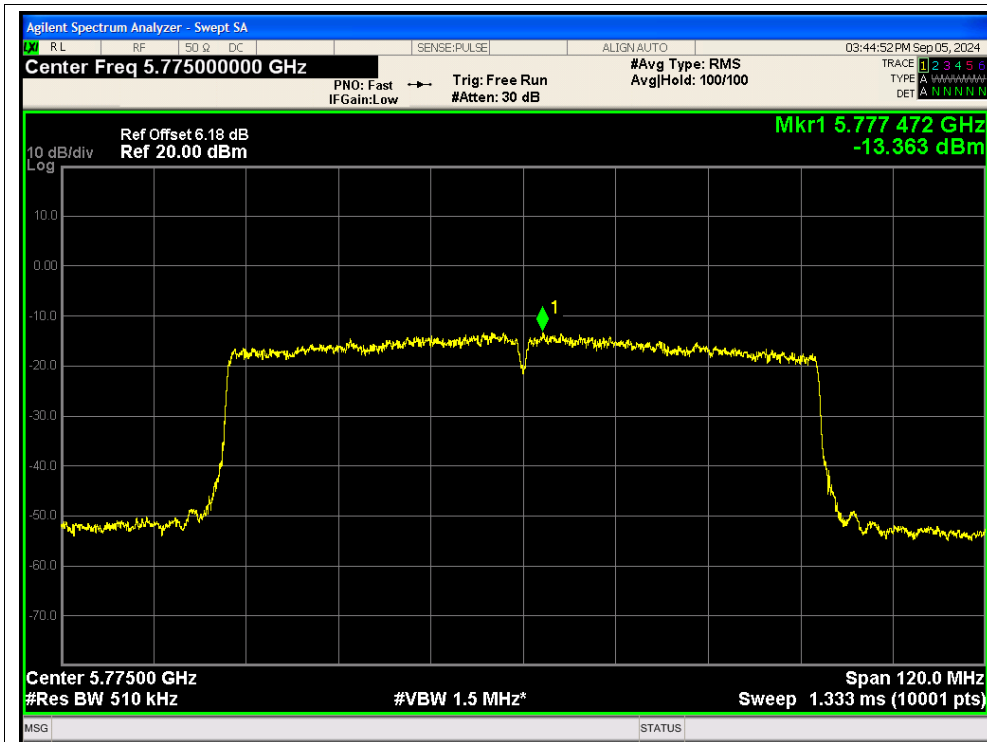


PSD NVNT ac80 5775MHz Ant2

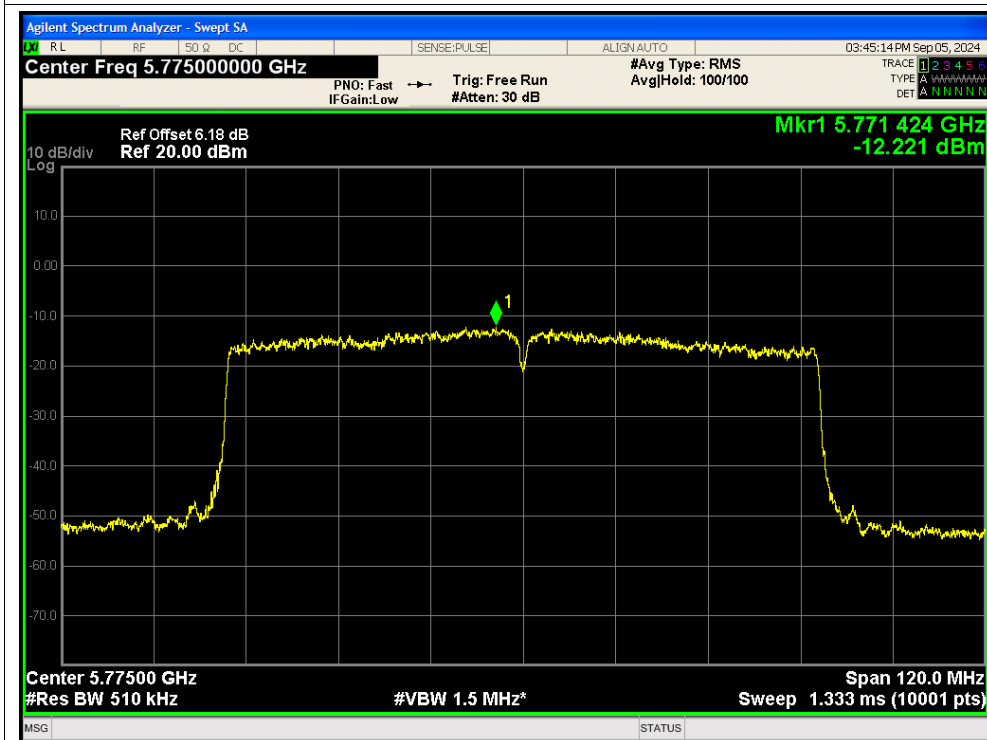


PSD NVNT ac80 5785MHz Ant1

Report

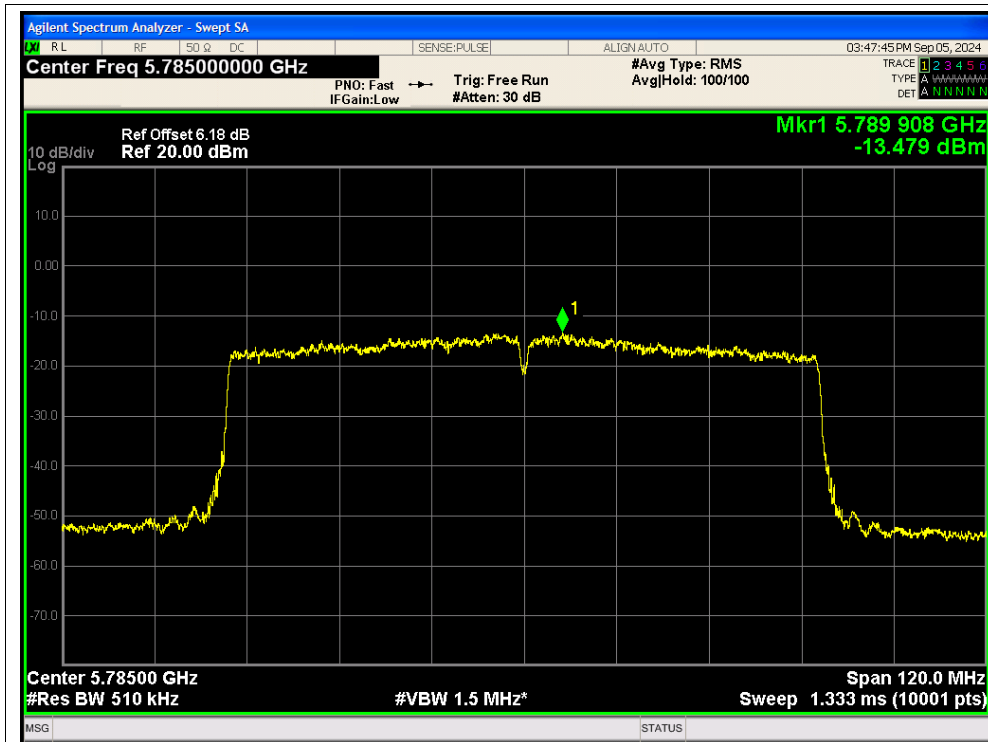


PSD NVNT ac80 5785MHz Ant2

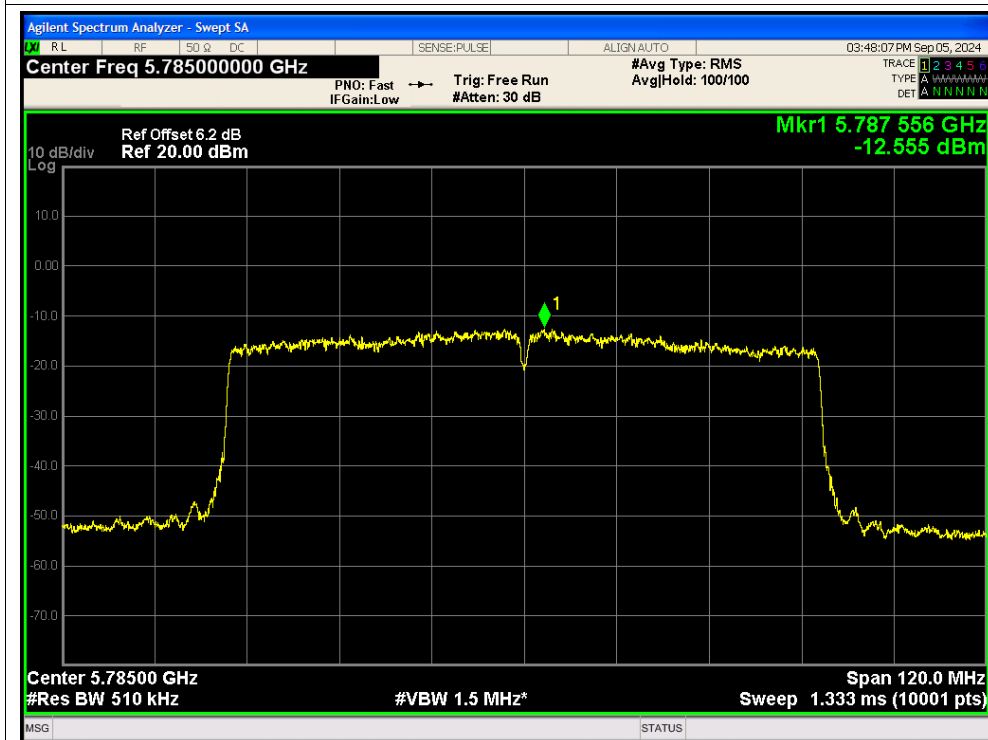


PSD NVNT ac80 5795MHz Ant1

Report

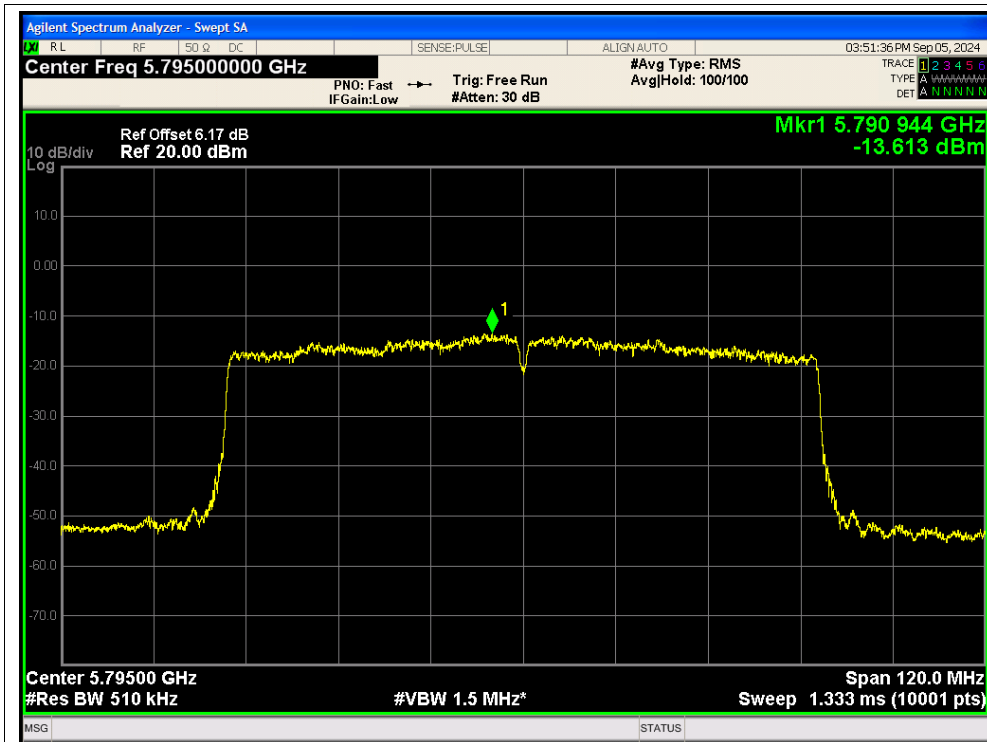


PSD NVNT ac80 5795MHz Ant2

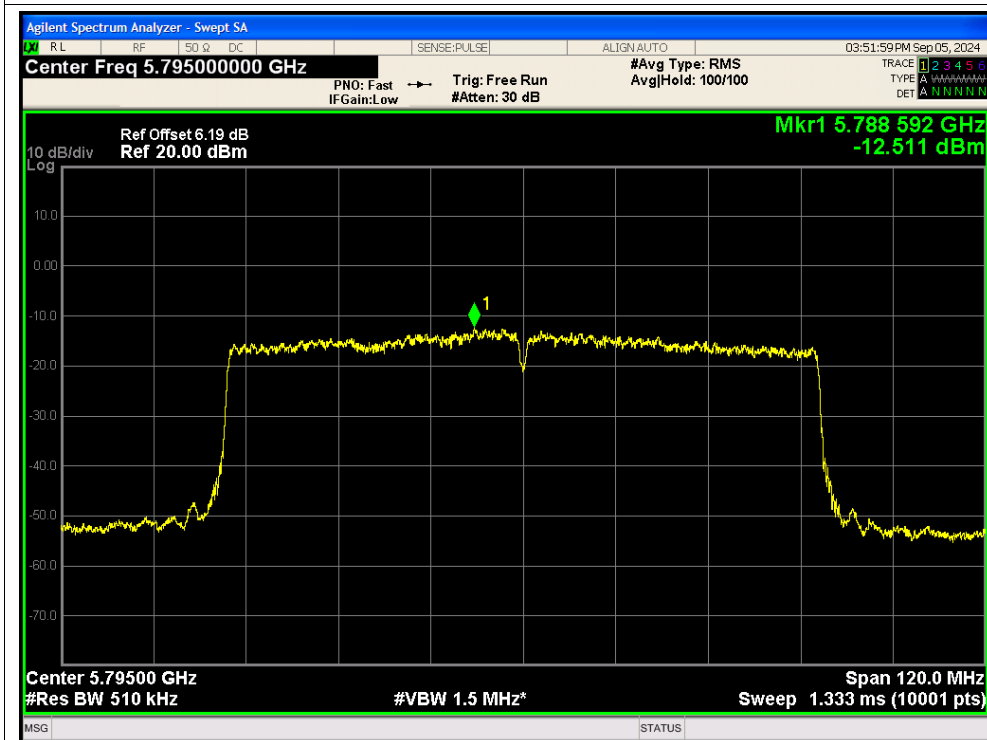


PSD NVNT n20 5180MHz Ant1

Report

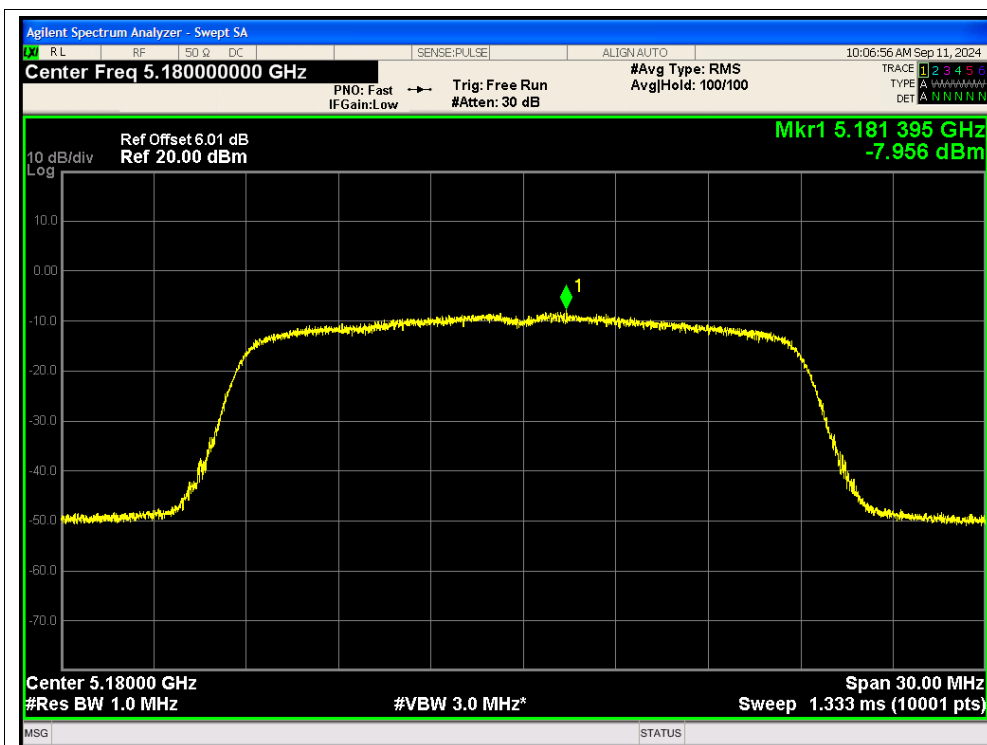


PSD NVNT n20 5180MHz Ant2

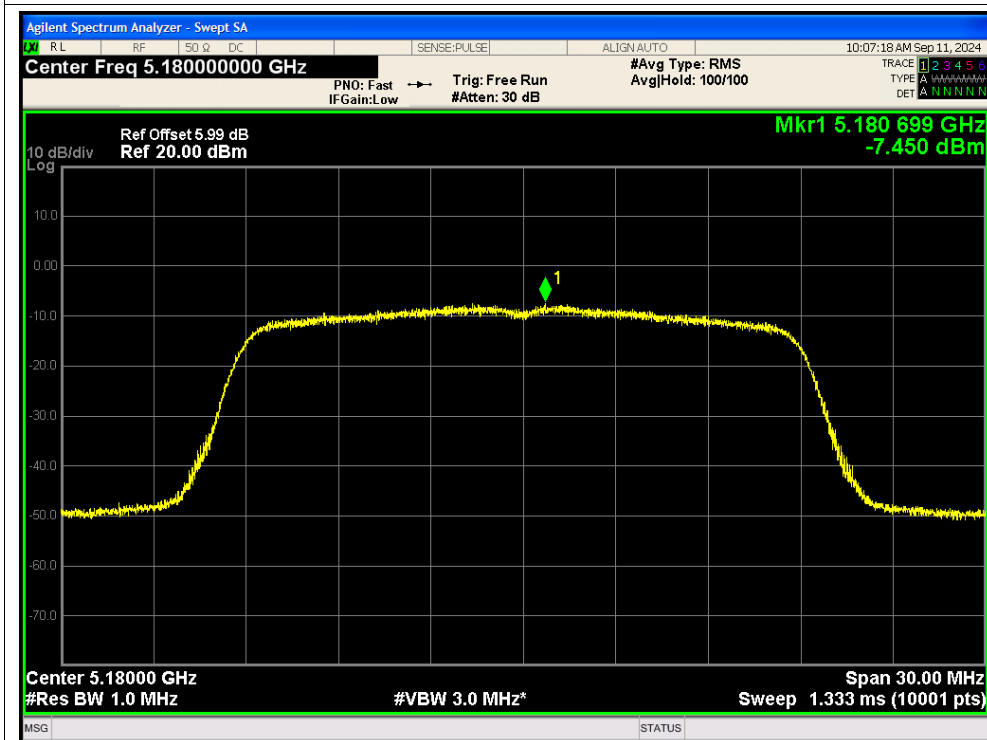


PSD NVNT n20 5210MHz Ant1

Report

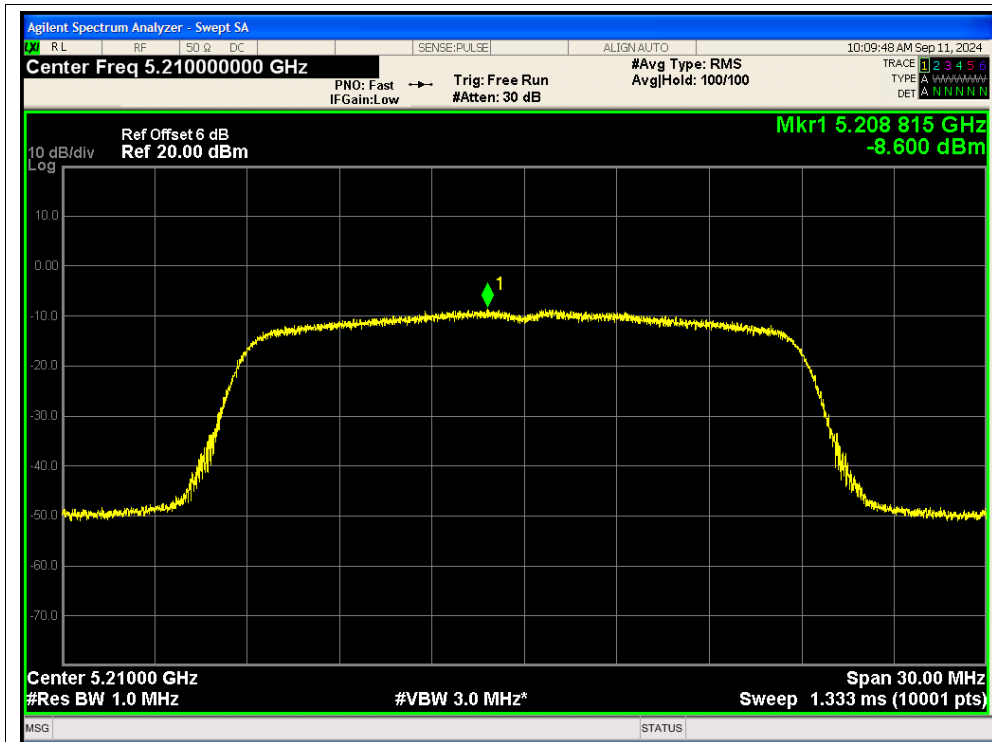


PSD NVNT n20 5210MHz Ant2

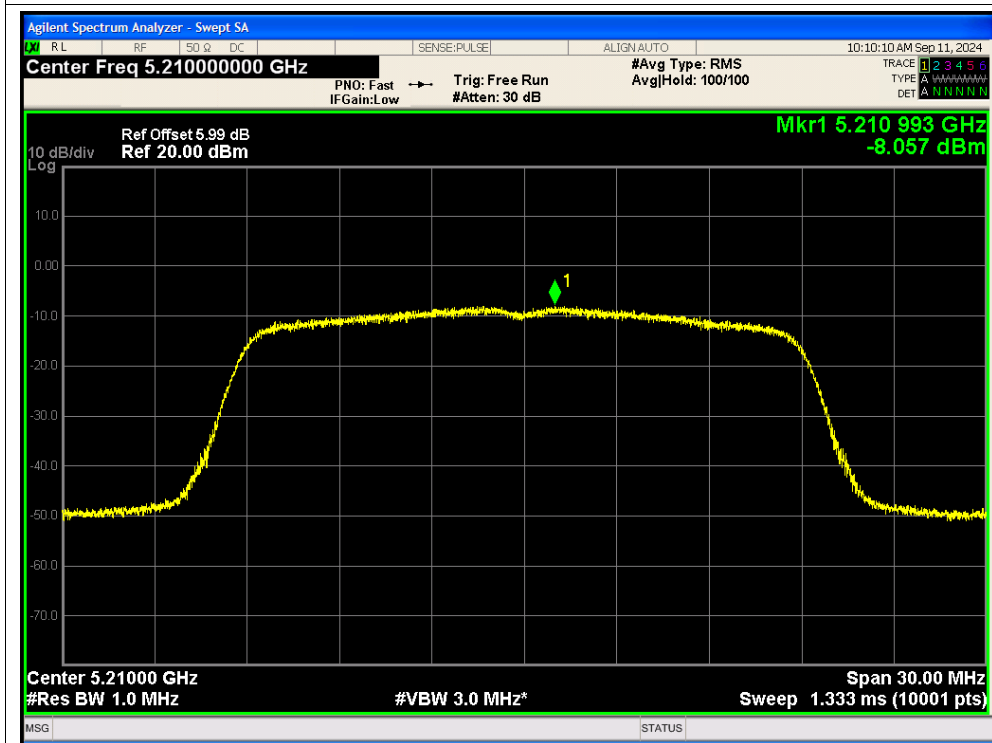


PSD NVNT n20 5240MHz Ant1

Report

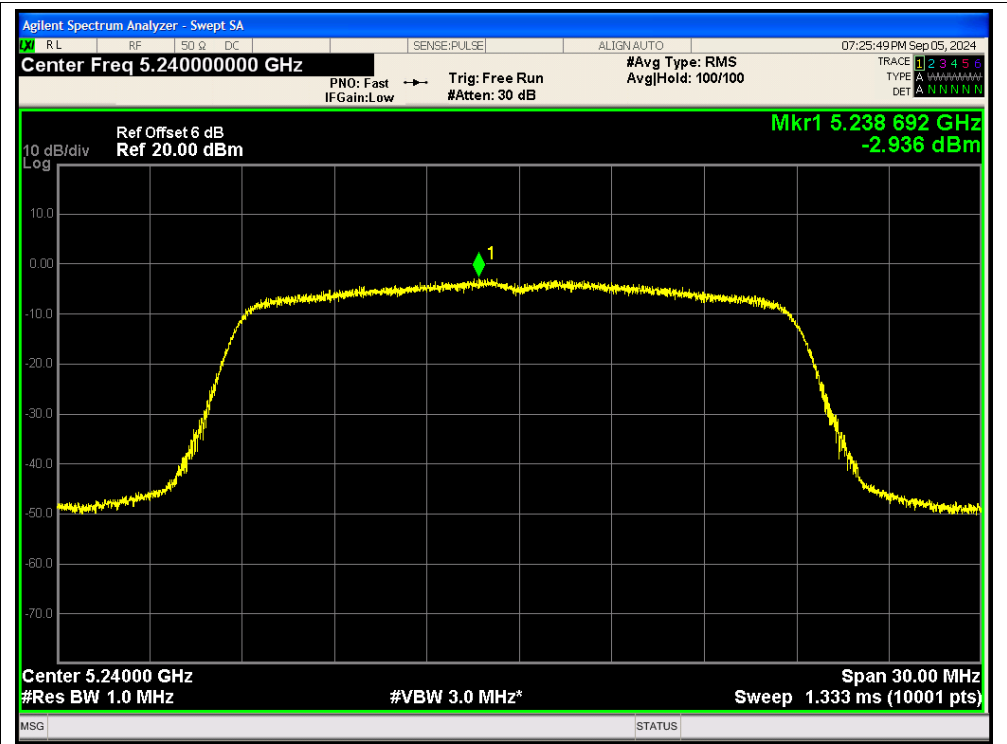


PSD NVNT n20 5240MHz Ant2

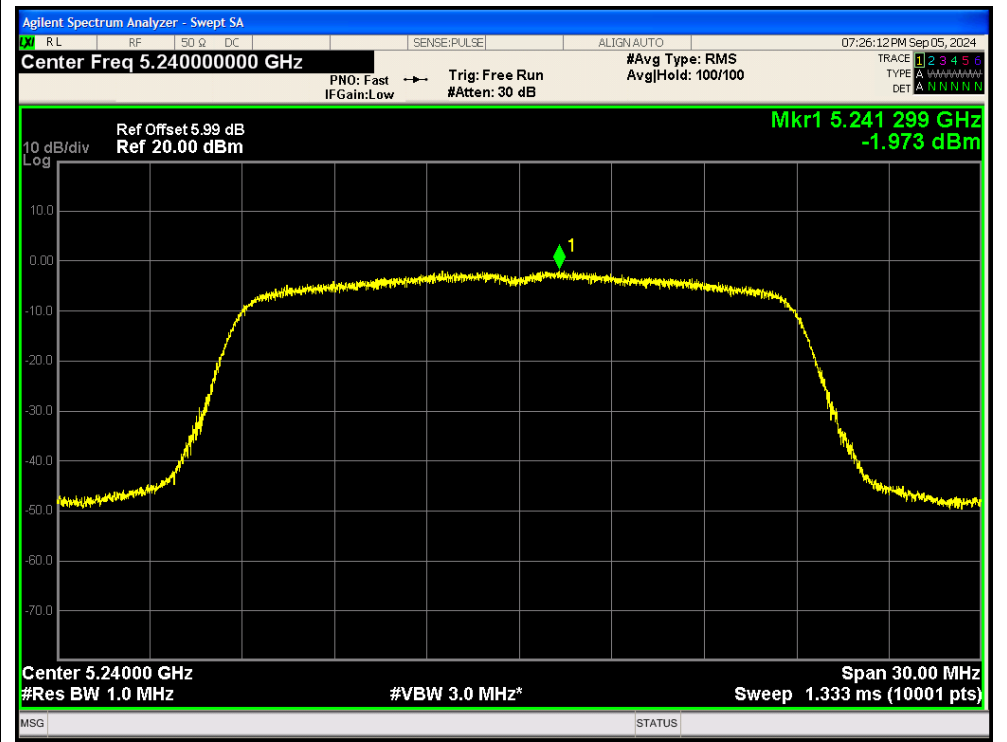


PSD NVNT n20 5260MHz Ant1

Report

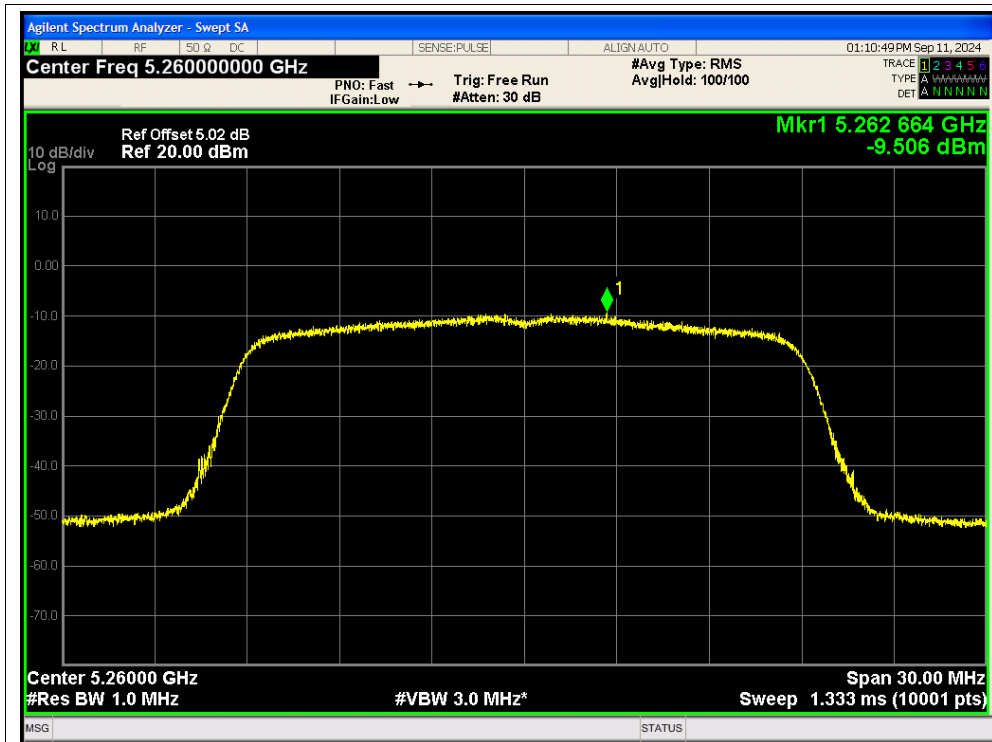


PSD NVNT n20 5260MHz Ant2

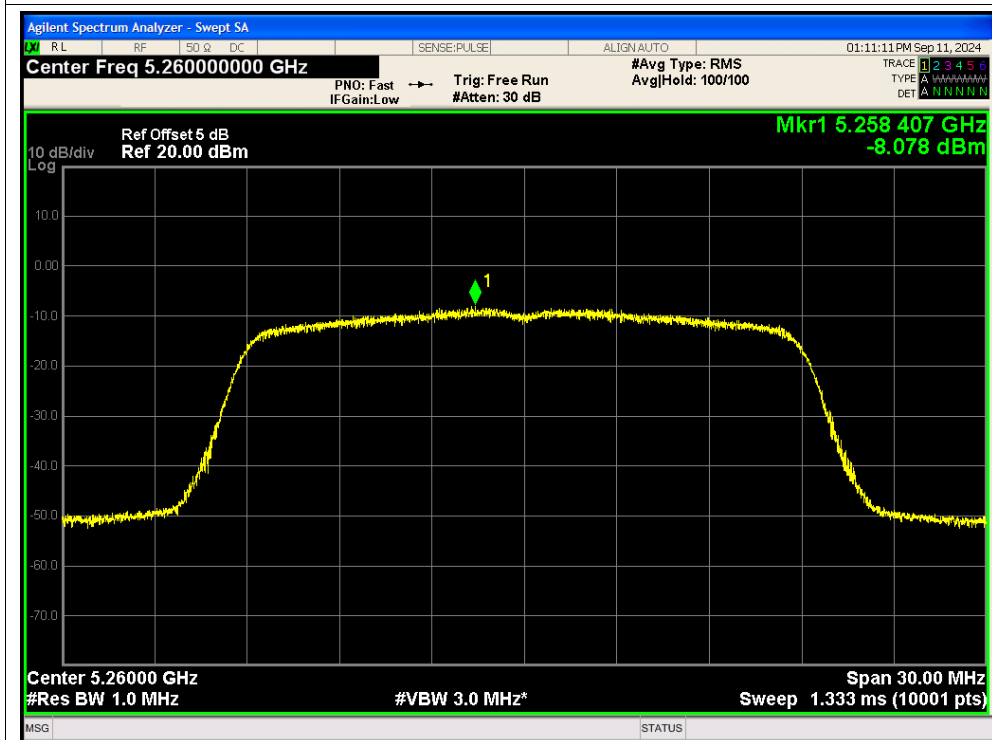


PSD NVNT n20 5290MHz Ant1

Report

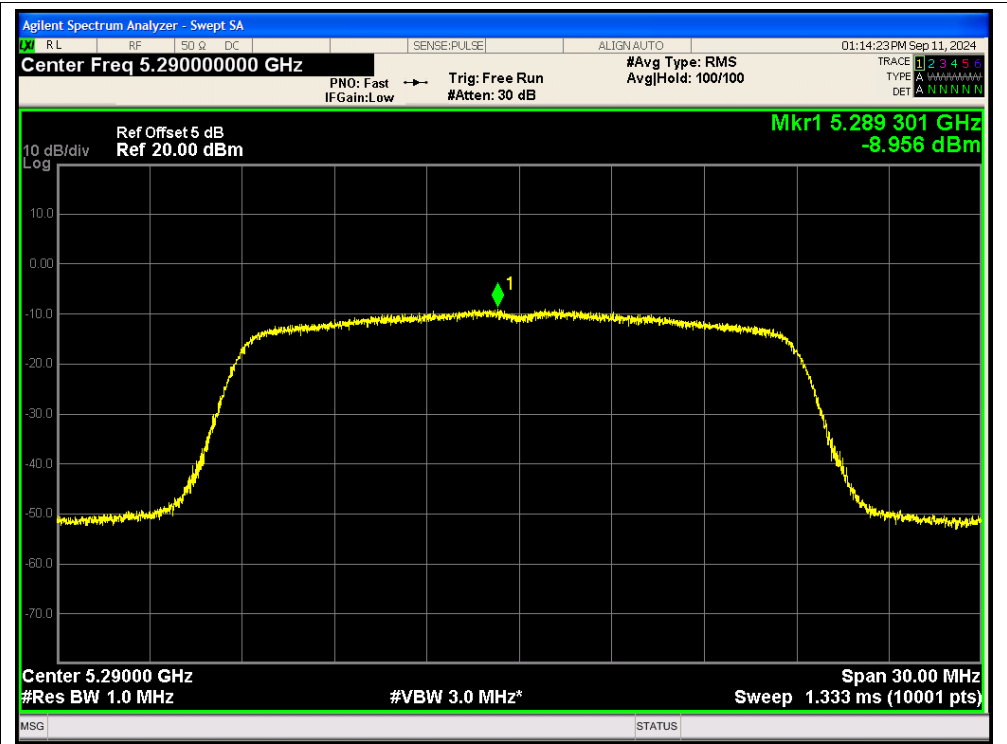


PSD NVNT n20 5290MHz Ant2

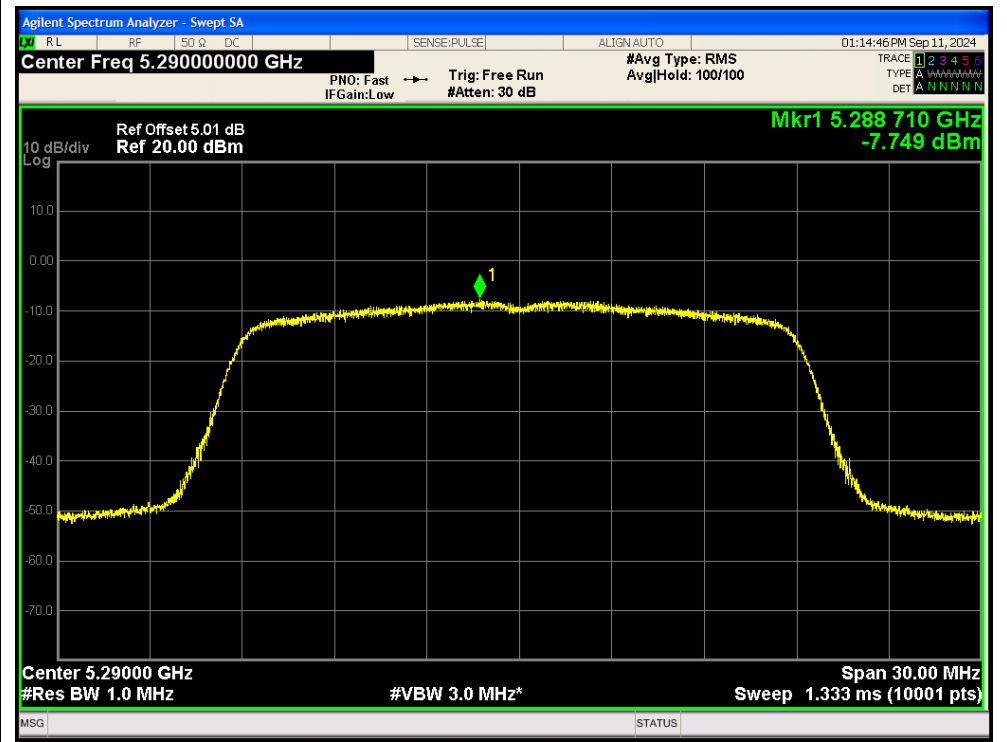


PSD NVNT n20 5320MHz Ant1

Report

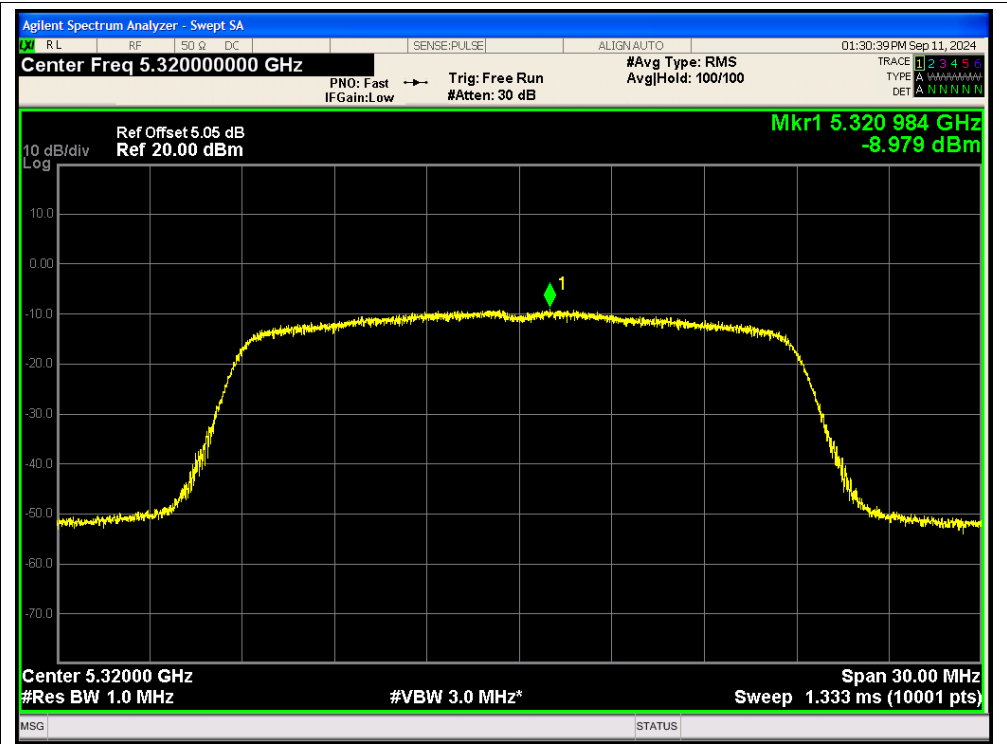


PSD NVNT n20 5320MHz Ant2

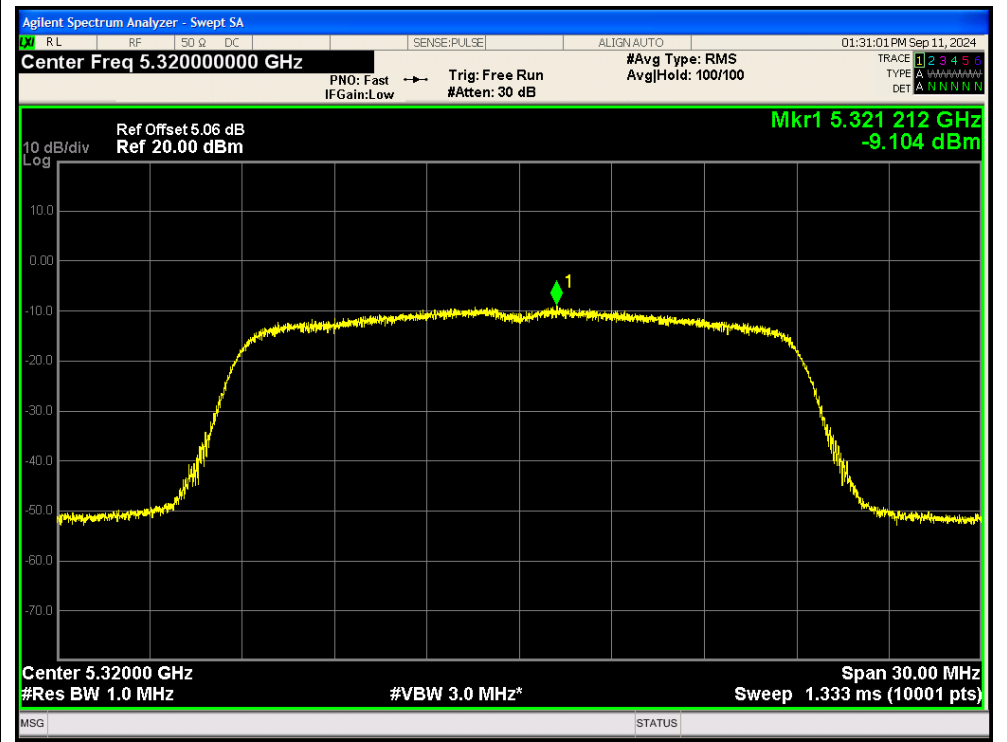


PSD NVNT n20 5500MHz Ant1

Report

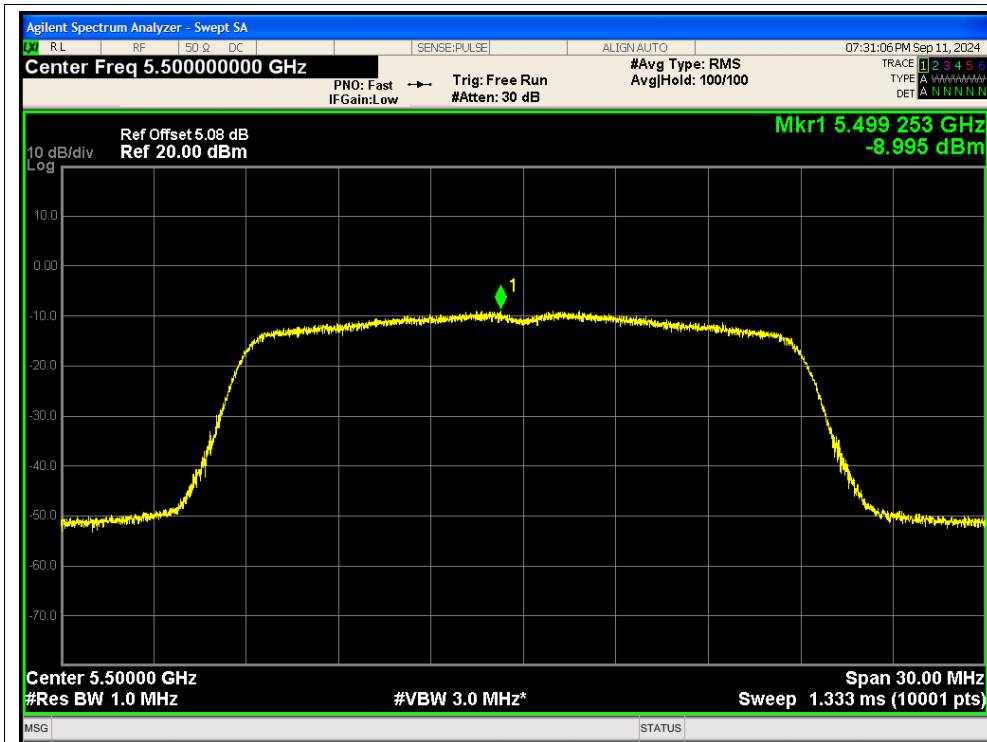


PSD NVNT n20 5500MHz Ant2

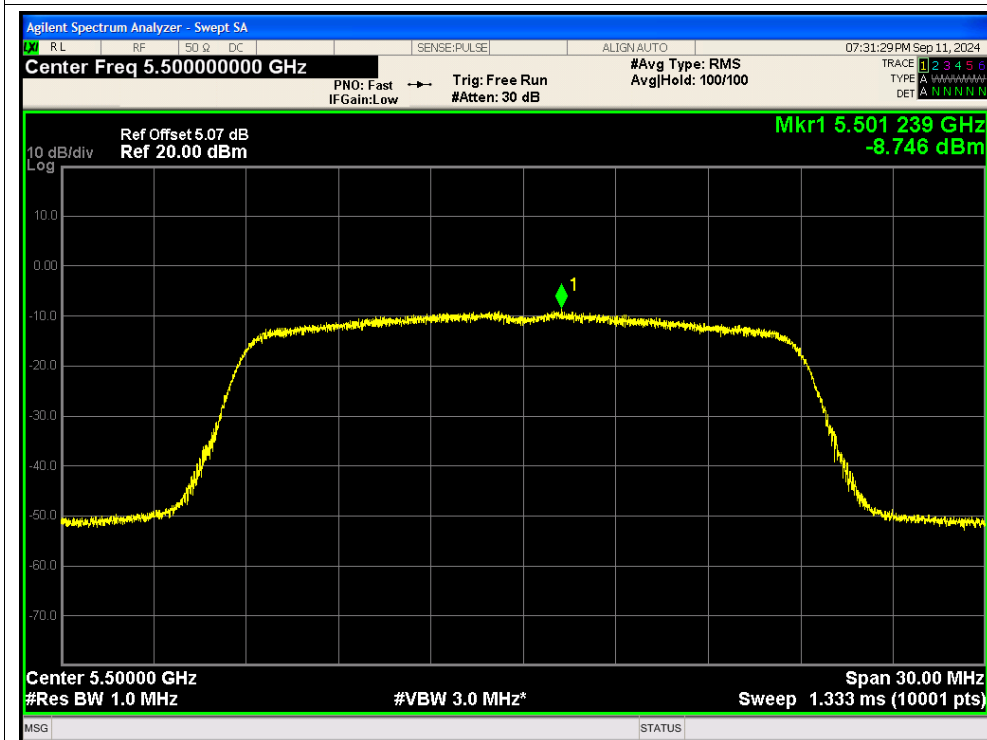


PSD NVNT n20 5600MHz Ant1

Report

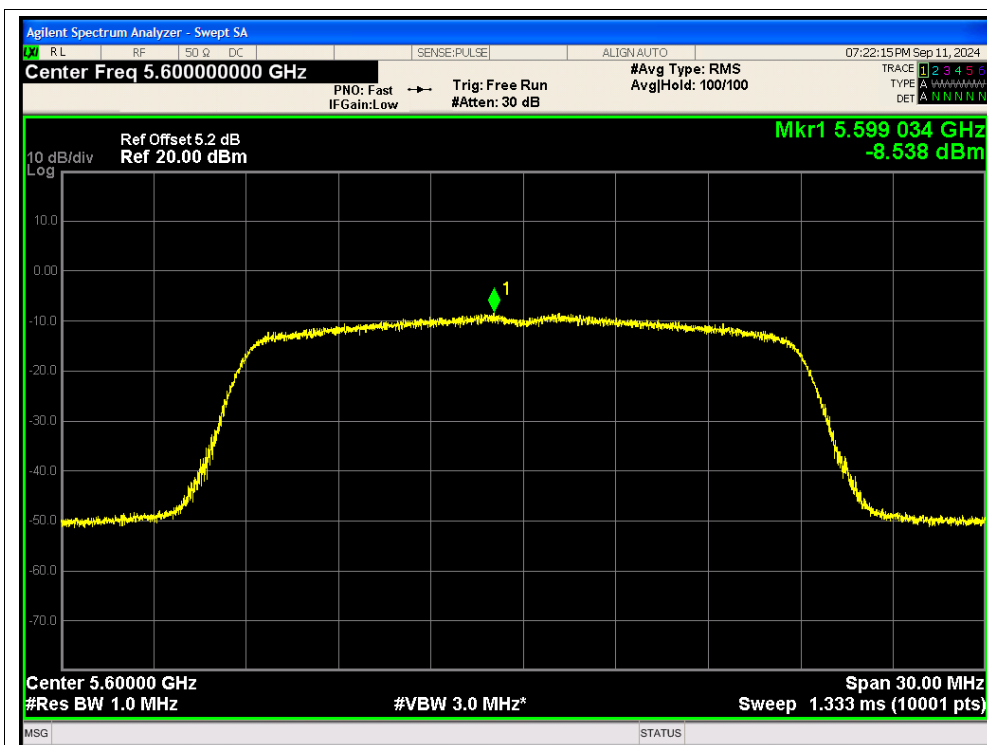


PSD NVNT n20 5600MHz Ant2

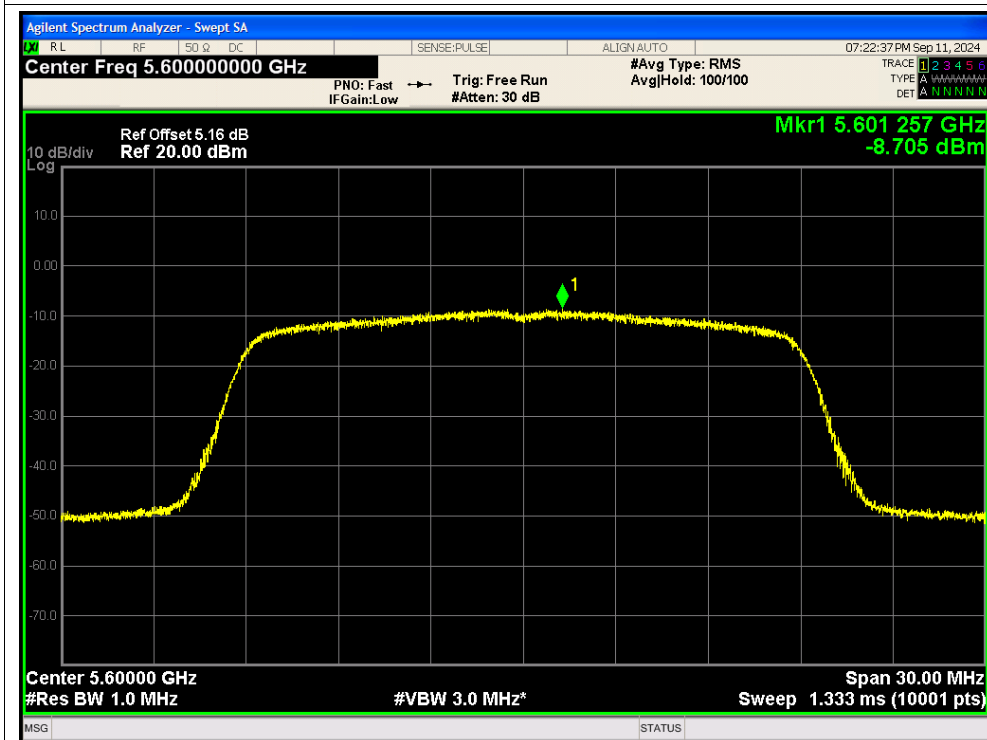


PSD NVNT n20 5700MHz Ant1

Report

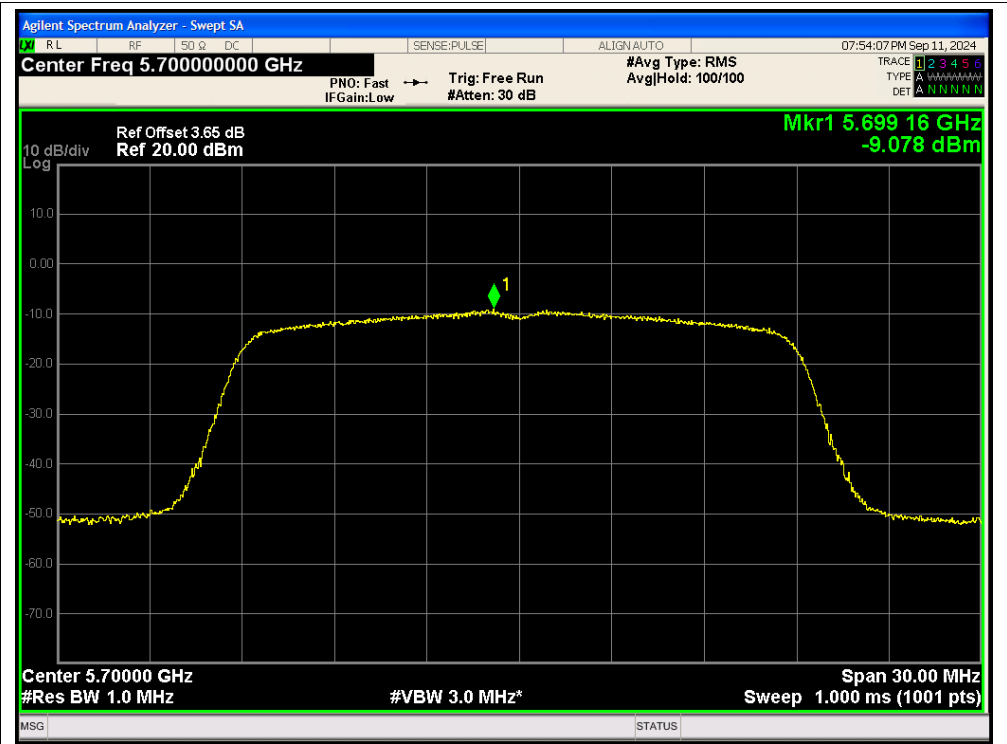


PSD NVNT n20 5700MHz Ant2

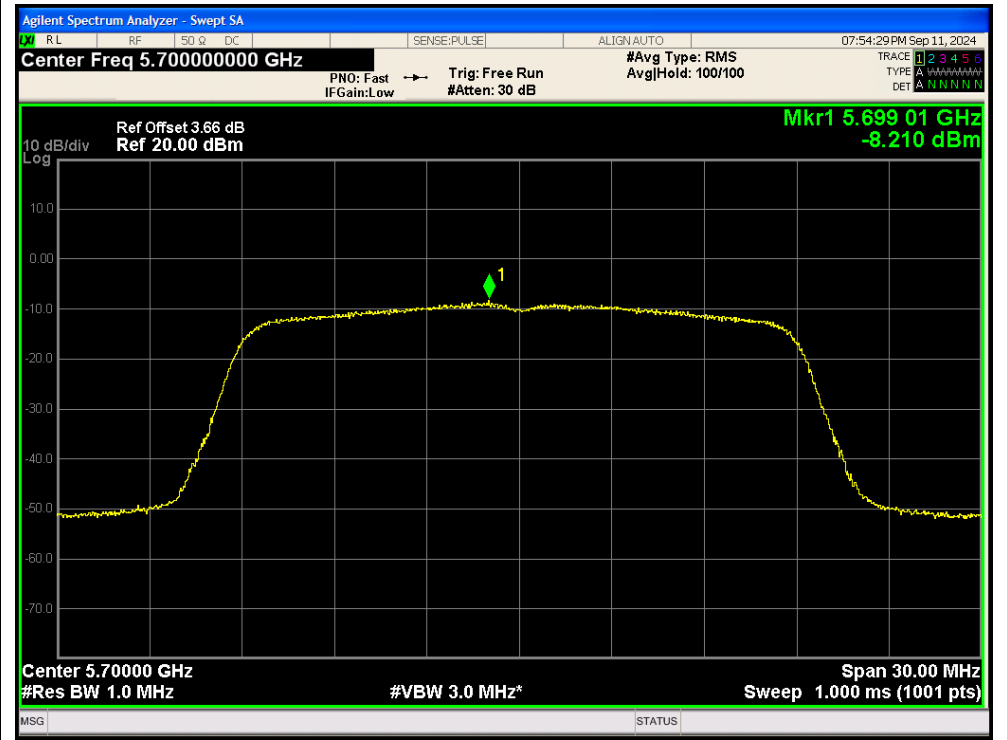


PSD NVNT n20 5745MHz Ant1

Report

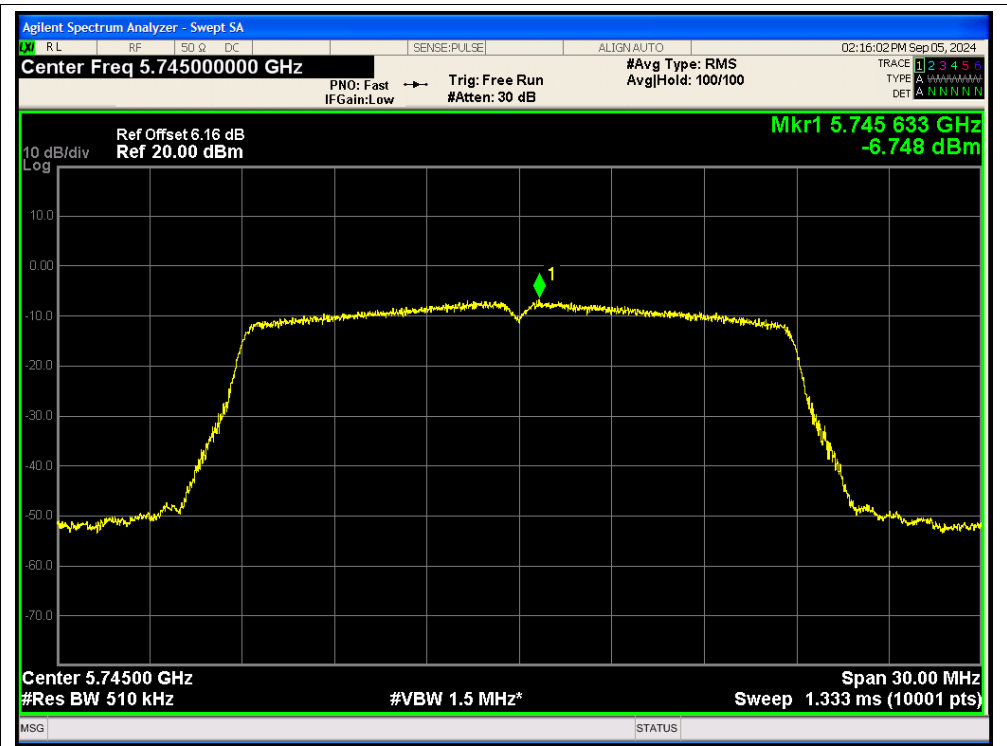


PSD NVNT n20 5745MHz Ant2

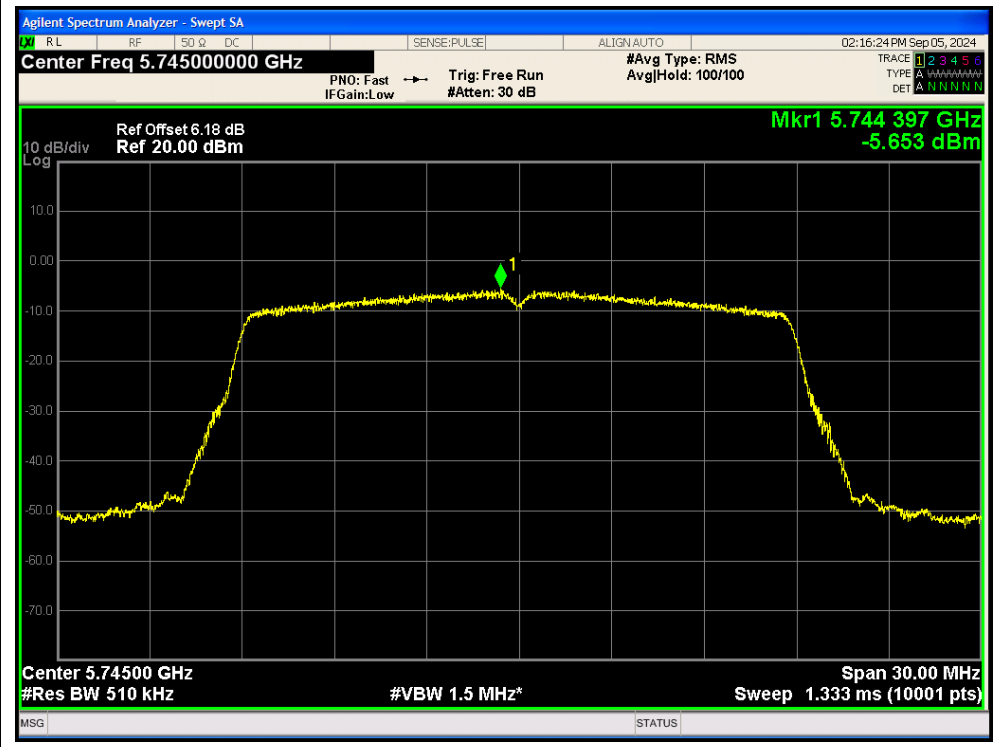


PSD NVNT n20 5785MHz Ant1

Report

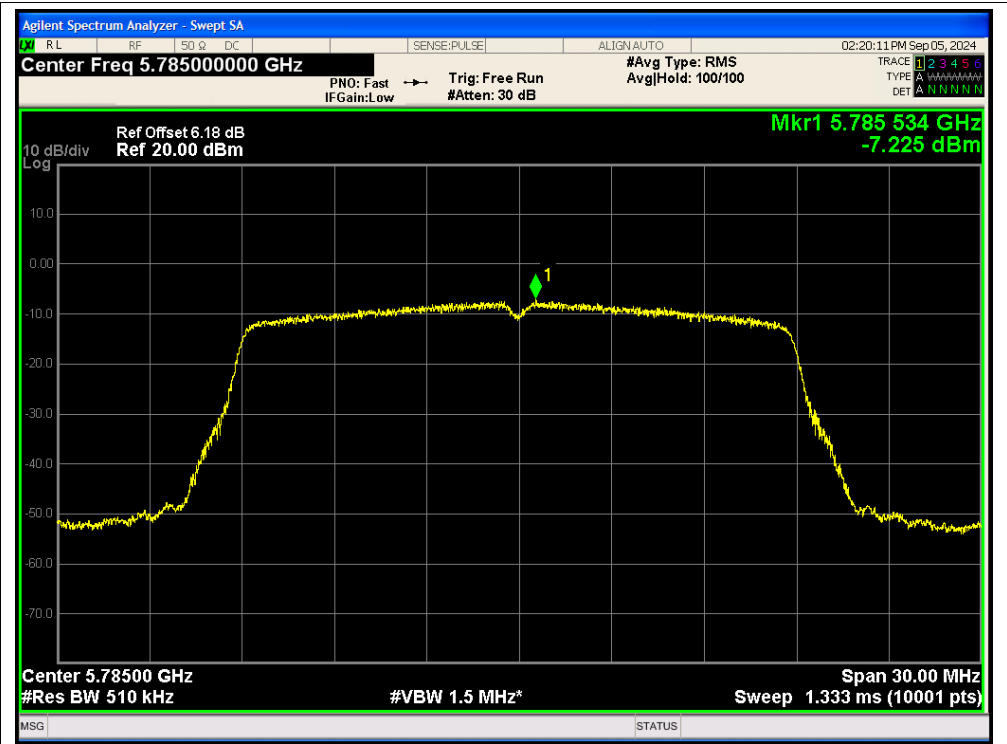

PSD NVNT n20 5785MHz Ant2

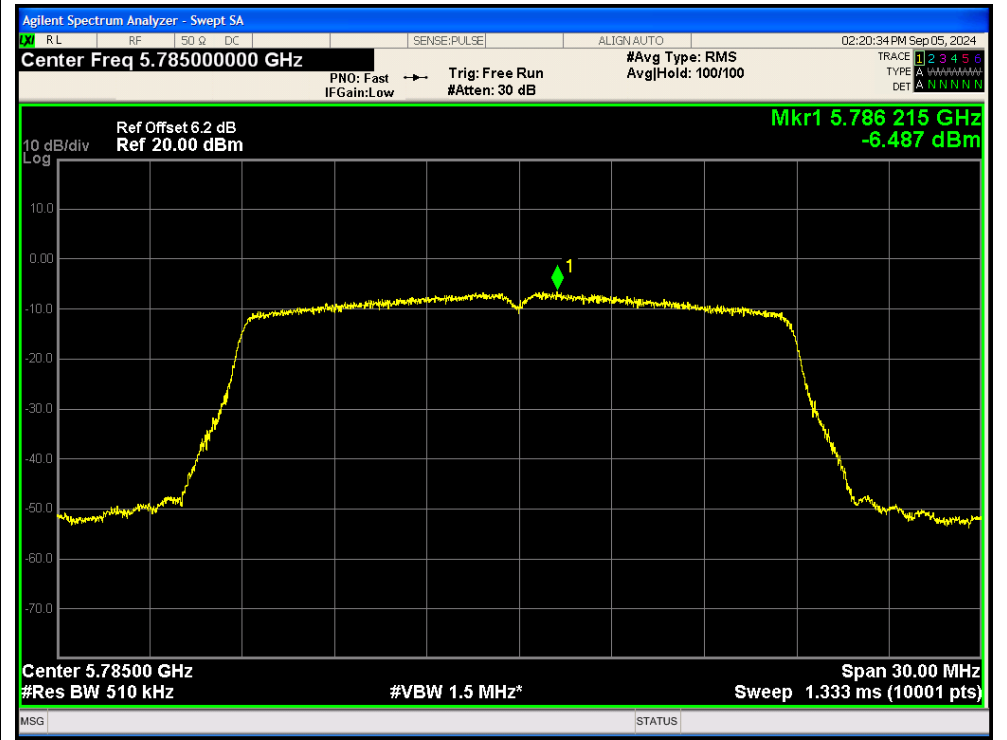

PSD NVNT n20 5825MHz Ant1