






11N40CDD_Ant2_High_2452






11AX20CDD_Ant1_Low_2412

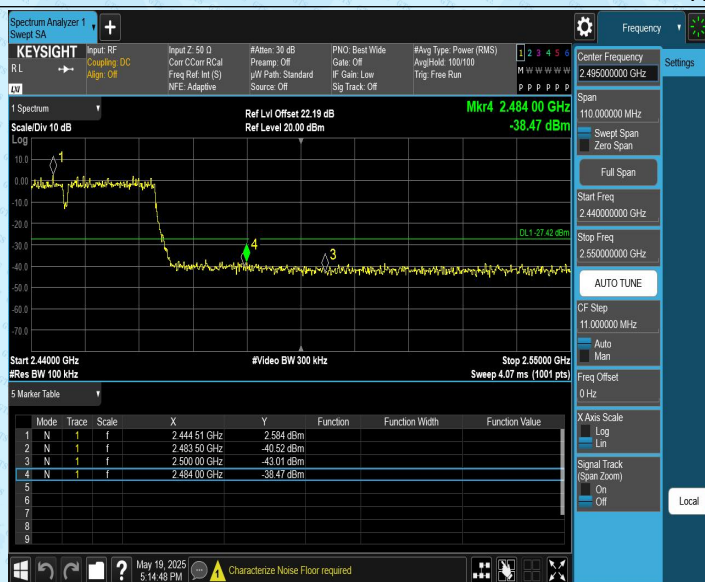

11AX20CDD_Ant2_Low_2412

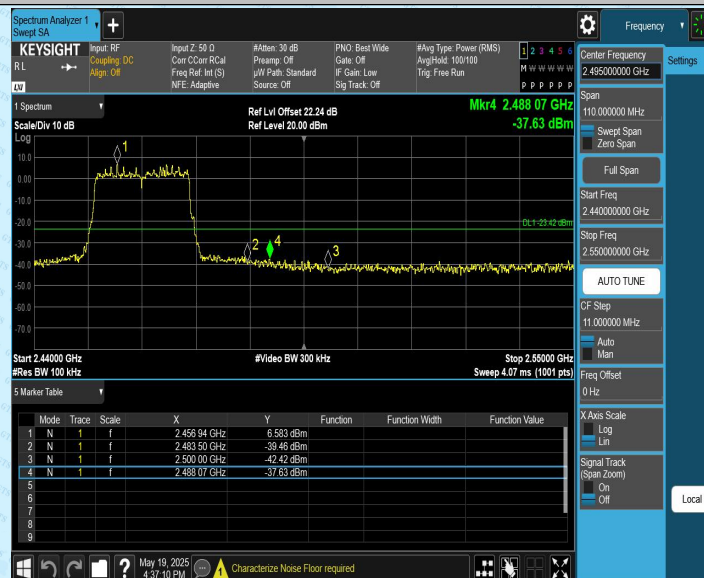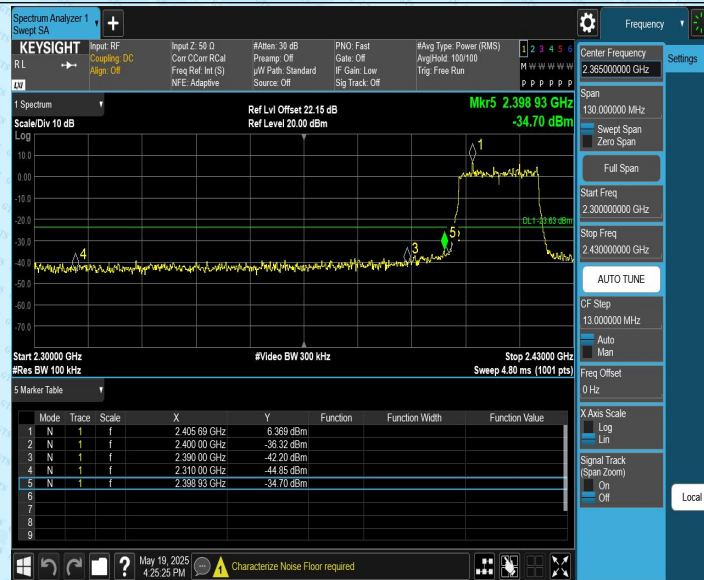

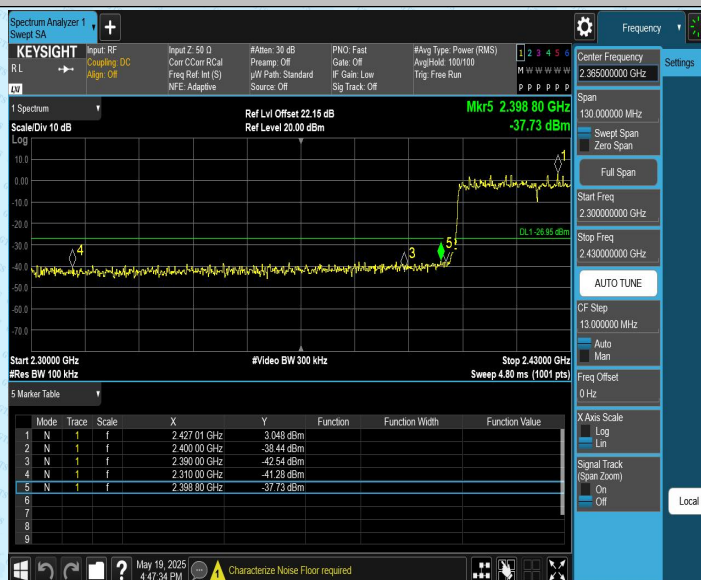

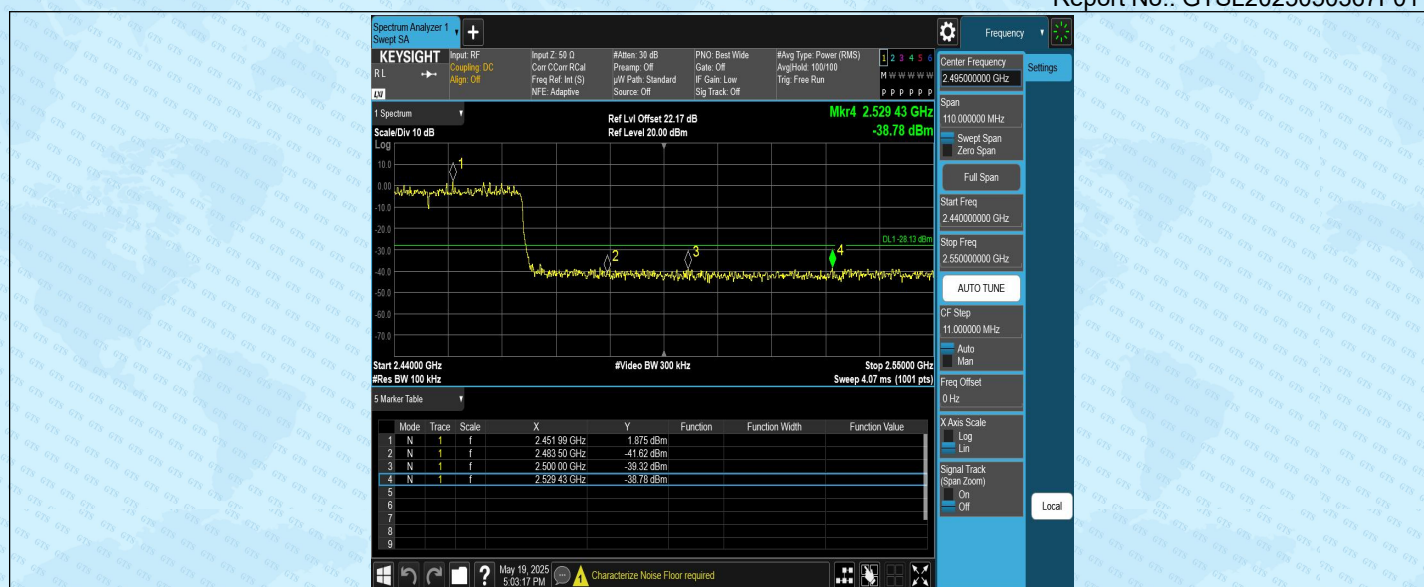

Appendix G: Conducted Spurious Emission

Test Result

TestMode	Antenna	Frequency[MHz]	FreqRange [Mhz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B-CDD	Ant1	2412	Reference	16.87	16.87	---	PASS
			30~1000	16.87	-49.77	≤ -3.13	PASS
			1000~26500	16.87	-38.5	≤ -3.13	PASS
	Ant2	2412	Reference	15.54	15.54	---	PASS
			30~1000	15.54	-49.56	≤ -4.46	PASS
			1000~26500	15.54	-39.56	≤ -4.46	PASS
	Ant1	2437	Reference	16.56	16.56	---	PASS
			30~1000	16.56	-50.18	≤ -3.44	PASS
			1000~26500	16.56	-39.6	≤ -3.44	PASS
	Ant2	2437	Reference	15.37	15.37	---	PASS
			30~1000	15.37	-49	≤ -4.63	PASS
			1000~26500	15.37	-39.64	≤ -4.63	PASS
	Ant1	2462	Reference	14.36	14.36	---	PASS
			30~1000	14.36	-50.02	≤ -5.64	PASS
			1000~26500	14.36	-39.84	≤ -5.64	PASS
	Ant2	2462	Reference	14.83	14.83	---	PASS
			30~1000	14.83	-49.61	≤ -5.17	PASS
			1000~26500	14.83	-39.39	≤ -5.17	PASS
11G-CDD	Ant1	2412	Reference	11.44	11.44	---	PASS
			30~1000	11.44	-49.81	≤ -8.56	PASS
			1000~26500	11.44	-39.25	≤ -8.56	PASS
	Ant2	2412	Reference	10.82	10.82	---	PASS
			30~1000	10.82	-49.62	≤ -9.18	PASS
			1000~26500	10.82	-39.64	≤ -9.18	PASS
	Ant1	2437	Reference	10.90	10.90	---	PASS
			30~1000	10.90	-49.28	≤ -9.1	PASS
			1000~26500	10.90	-38.48	≤ -9.1	PASS
	Ant2	2437	Reference	13.43	13.43	---	PASS
			30~1000	13.43	-49.56	≤ -6.57	PASS
			1000~26500	13.43	-38.73	≤ -6.57	PASS
	Ant1	2462	Reference	11.68	11.68	---	PASS
			30~1000	11.68	-49.94	≤ -8.32	PASS
			1000~26500	11.68	-38.97	≤ -8.32	PASS
	Ant2	2462	Reference	11.28	11.28	---	PASS
			30~1000	11.28	-50.11	≤ -8.72	PASS
			1000~26500	11.28	-38.26	≤ -8.72	PASS
11N20CDD	Ant1	2412	Reference	11.93	11.93	---	PASS
			30~1000	11.93	-49.53	≤ -8.07	PASS
			1000~26500	11.93	-39.26	≤ -8.07	PASS

	Ant2	2412	Reference	10.61	10.61	---	PASS
			30~1000	10.61	-49.61	≤ -9.39	PASS
			1000~26500	10.61	-39.63	≤ -9.39	PASS
	Ant1	2437	Reference	11.26	11.26	---	PASS
			30~1000	11.26	-50.12	≤ -8.74	PASS
			1000~26500	11.26	-39.06	≤ -8.74	PASS
	Ant2	2437	Reference	11.54	11.54	---	PASS
			30~1000	11.54	-49.34	≤ -8.46	PASS
			1000~26500	11.54	-38.73	≤ -8.46	PASS
	Ant1	2462	Reference	10.78	10.78	---	PASS
			30~1000	10.78	-48.81	≤ -9.22	PASS
			1000~26500	10.78	-39.61	≤ -9.22	PASS
	Ant2	2462	Reference	11.55	11.55	---	PASS
			30~1000	11.55	-49.47	≤ -8.45	PASS
			1000~26500	11.55	-38.46	≤ -8.45	PASS
11N40CDD	Ant1	2422	Reference	9.51	9.51	---	PASS
			30~1000	9.51	-49.83	≤ -10.49	PASS
			1000~26500	9.51	-39.05	≤ -10.49	PASS
	Ant2	2422	Reference	5.33	5.33	---	PASS
			30~1000	5.33	-49.08	≤ -14.67	PASS
			1000~26500	5.33	-39.28	≤ -14.67	PASS
	Ant1	2437	Reference	8.70	8.70	---	PASS
			30~1000	8.70	-49.46	≤ -11.3	PASS
			1000~26500	8.70	-34.75	≤ -11.3	PASS
	Ant2	2437	Reference	9.04	9.04	---	PASS
			30~1000	9.04	-50.49	≤ -10.96	PASS
			1000~26500	9.04	-34.4	≤ -10.96	PASS
	Ant1	2452	Reference	8.61	8.61	---	PASS
			30~1000	8.61	-50.04	≤ -11.39	PASS
			1000~26500	8.61	-37.38	≤ -11.39	PASS
	Ant2	2452	Reference	7.93	7.93	---	PASS
			30~1000	7.93	-49.32	≤ -12.07	PASS
			1000~26500	7.93	-38.21	≤ -12.07	PASS
11AX20CDD	Ant1	2412	Reference	8.81	8.81	---	PASS
			30~1000	8.81	-48.32	≤ -11.19	PASS
			1000~26500	8.81	-38.65	≤ -11.19	PASS
	Ant2	2412	Reference	9.22	9.22	---	PASS
			30~1000	9.22	-49.9	≤ -10.78	PASS
			1000~26500	9.22	-39.24	≤ -10.78	PASS
	Ant1	2437	Reference	9.68	9.68	---	PASS
			30~1000	9.68	-49.76	≤ -10.32	PASS
			1000~26500	9.68	-38.02	≤ -10.32	PASS
	Ant2	2437	Reference	14.25	14.25	---	PASS
			30~1000	14.25	-49.22	≤ -5.75	PASS
			1000~26500	14.25	-36.12	≤ -5.75	PASS


11AX40CDD	Ant1	2462	Reference	13.67	13.67	---	PASS
			30~1000	13.67	-49.35	≤ -6.33	PASS
			1000~26500	13.67	-38.93	≤ -6.33	PASS
	Ant2	2462	Reference	11.47	11.47	---	PASS
			30~1000	11.47	-49.2	≤ -8.53	PASS
			1000~26500	11.47	-35.4	≤ -8.53	PASS
	Ant1	2422	Reference	8.81	8.81	---	PASS
			30~1000	8.81	-50.04	≤ -11.19	PASS
			1000~26500	8.81	-39.64	≤ -11.19	PASS
	Ant2	2422	Reference	7.41	7.41	---	PASS
			30~1000	7.41	-49.57	≤ -12.59	PASS
			1000~26500	7.41	-38.98	≤ -12.59	PASS
	Ant1	2437	Reference	9.15	9.15	---	PASS
			30~1000	9.15	-48.42	≤ -10.85	PASS
			1000~26500	9.15	-37.2	≤ -10.85	PASS
11AX40CDD	Ant2	2437	Reference	9.12	9.12	---	PASS
			30~1000	9.12	-49.95	≤ -10.88	PASS
			1000~26500	9.12	-35.56	≤ -10.88	PASS
	Ant1	2452	Reference	7.48	7.48	---	PASS
			30~1000	7.48	-49.7	≤ -12.52	PASS
			1000~26500	7.48	-38.92	≤ -12.52	PASS
	Ant2	2452	Reference	6.92	6.92	---	PASS
			30~1000	6.92	-49.37	≤ -13.08	PASS
			1000~26500	6.92	-39.97	≤ -13.08	PASS

Test Graphs


11B-CDD_Ant1_2412_0~Reference



11B-CDD_Ant1_2412_30~1000

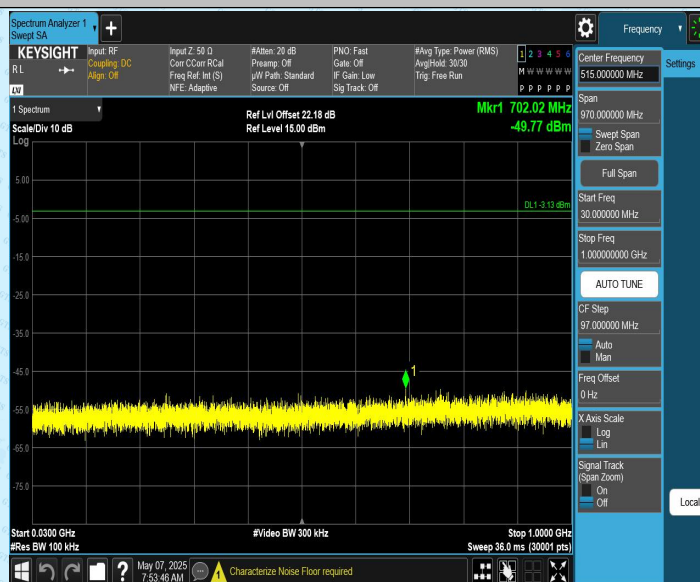


11B-CDD_Ant1_2412_1000~26500

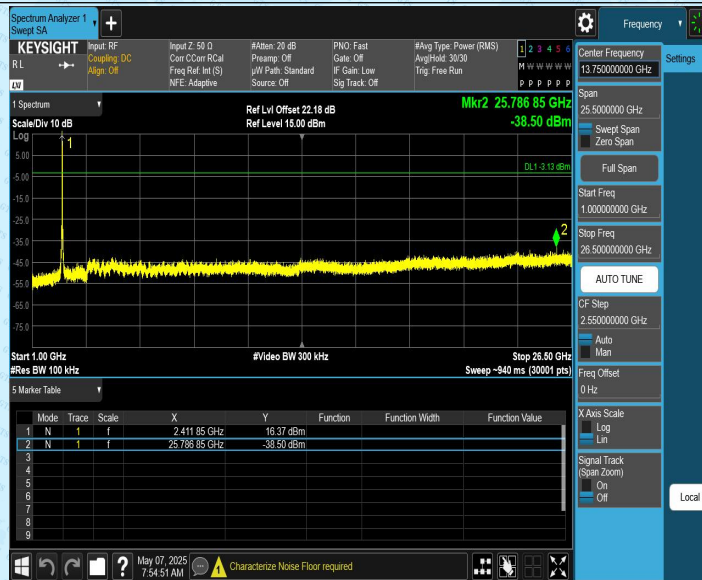


11B-CDD_Ant2_2412_0~Reference



11B-CDD_Ant2_2412_30~1000

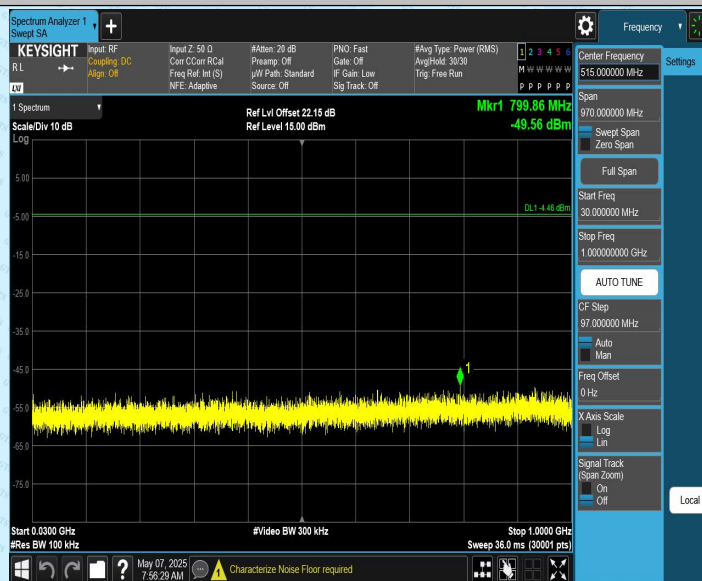


11B-CDD_Ant2_2412_1000~26500

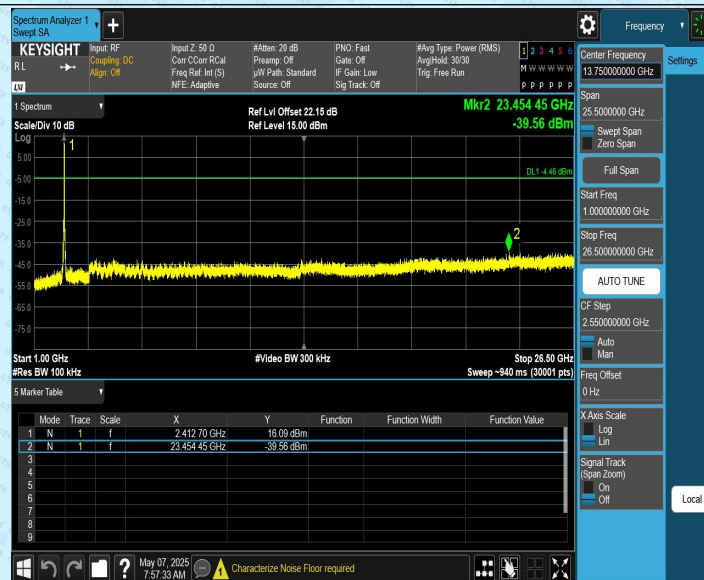

11B-CDD_Ant1_2437_0~Reference



11B-CDD_Ant1_2437_30~1000

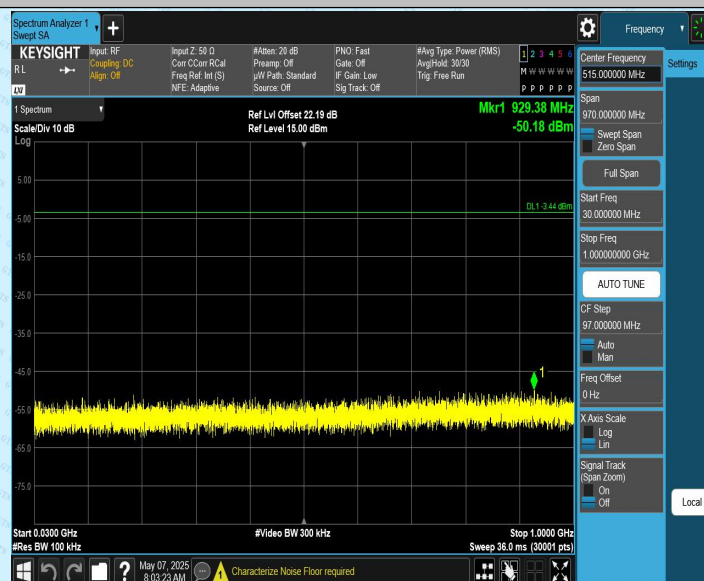

11B-CDD_Ant1_2437_1000~26500