



Appendix Q: Test Data for E-UTRA Band 41

Product Name: In-Vehicle Display Terminal

Test Model: VT-7A

Environmental Conditions

Temperature:	23.9° C
Relative Humidity:	52.3%
ATM Pressure:	100.0 kPa
Test Engineer:	Can Kun
Supervised by:	Nick Peng





Q.1 Conducted Output Power Data

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	21.43	PASS
Band41	5MHz	16QAM	39675	1RB#0	21.21	PASS
Band41	5MHz	QPSK	39675	1RB#12	21.40	PASS
Band41	5MHz	16QAM	39675	1RB#12	22.00	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.46	PASS
Band41	5MHz	16QAM	39675	1RB#24	21.27	PASS
Band41	5MHz	QPSK	39675	12RB#0	20.55	PASS
Band41	5MHz	16QAM	39675	12RB#0	19.85	PASS
Band41	5MHz	QPSK	39675	12RB#6	20.57	PASS
Band41	5MHz	16QAM	39675	12RB#6	19.86	PASS
Band41	5MHz	QPSK	39675	12RB#13	20.63	PASS
Band41	5MHz	16QAM	39675	12RB#13	19.83	PASS
Band41	5MHz	QPSK	39675	25RB#0	20.62	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.00	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.11	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.78	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.94	PASS
Band41	5MHz	16QAM	40620	1RB#12	22.04	PASS
Band41	5MHz	QPSK	40620	1RB#24	22.03	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.83	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.99	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.35	PASS
Band41	5MHz	QPSK	40620	12RB#6	21.00	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.36	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.96	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.26	PASS
Band41	5MHz	QPSK	40620	25RB#0	21.00	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.47	PASS
Band41	5MHz	QPSK	41565	1RB#0	21.50	PASS
Band41	5MHz	16QAM	41565	1RB#0	21.29	PASS
Band41	5MHz	QPSK	41565	1RB#12	21.41	PASS
Band41	5MHz	16QAM	41565	1RB#12	21.25	PASS
Band41	5MHz	QPSK	41565	1RB#24	21.53	PASS
Band41	5MHz	16QAM	41565	1RB#24	21.22	PASS
Band41	5MHz	QPSK	41565	12RB#0	20.51	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	19.81	PASS
Band41	5MHz	QPSK	41565	12RB#6	20.49	PASS
Band41	5MHz	16QAM	41565	12RB#6	19.66	PASS
Band41	5MHz	QPSK	41565	12RB#13	20.41	PASS
Band41	5MHz	16QAM	41565	12RB#13	19.72	PASS
Band41	5MHz	QPSK	41565	25RB#0	20.63	PASS
Band41	5MHz	16QAM	41565	25RB#0	20.00	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.17	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.08	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.22	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.07	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.22	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.15	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.09	PASS
Band41	10MHz	16QAM	39700	25RB#0	20.40	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.11	PASS
Band41	10MHz	16QAM	39700	25RB#12	20.40	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.21	PASS
Band41	10MHz	16QAM	39700	25RB#25	20.50	PASS
Band41	10MHz	QPSK	39700	50RB#0	21.12	PASS
Band41	10MHz	16QAM	39700	50RB#0	20.55	PASS
Band41	10MHz	QPSK	40620	1RB#0	22.32	PASS
Band41	10MHz	16QAM	40620	1RB#0	22.28	PASS
Band41	10MHz	QPSK	40620	1RB#24	22.24	PASS
Band41	10MHz	16QAM	40620	1RB#24	22.21	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.21	PASS
Band41	10MHz	16QAM	40620	1RB#49	22.14	PASS
Band41	10MHz	QPSK	40620	25RB#0	21.08	PASS
Band41	10MHz	16QAM	40620	25RB#0	20.52	PASS
Band41	10MHz	QPSK	40620	25RB#12	21.09	PASS
Band41	10MHz	16QAM	40620	25RB#12	20.53	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.14	PASS
Band41	10MHz	16QAM	40620	25RB#25	20.53	PASS
Band41	10MHz	QPSK	40620	50RB#0	21.18	PASS
Band41	10MHz	16QAM	40620	50RB#0	20.55	PASS
Band41	10MHz	QPSK	41540	1RB#0	21.67	PASS
Band41	10MHz	16QAM	41540	1RB#0	21.47	PASS
Band41	10MHz	QPSK	41540	1RB#24	21.59	PASS
Band41	10MHz	16QAM	41540	1RB#24	21.48	PASS
Band41	10MHz	QPSK	41540	1RB#49	21.68	PASS





Band41	10MHz	16QAM	41540	1RB#49	21.47	PASS
Band41	10MHz	QPSK	41540	25RB#0	20.50	PASS
Band41	10MHz	16QAM	41540	25RB#0	19.82	PASS
Band41	10MHz	QPSK	41540	25RB#12	20.51	PASS
Band41	10MHz	16QAM	41540	25RB#12	19.83	PASS
Band41	10MHz	QPSK	41540	25RB#25	20.60	PASS
Band41	10MHz	16QAM	41540	25RB#25	19.81	PASS
Band41	10MHz	QPSK	41540	50RB#0	20.56	PASS
Band41	10MHz	16QAM	41540	50RB#0	19.81	PASS
Band41	15MHz	QPSK	39725	1RB#0	21.78	PASS
Band41	15MHz	16QAM	39725	1RB#0	21.26	PASS
Band41	15MHz	QPSK	39725	1RB#38	21.74	PASS
Band41	15MHz	16QAM	39725	1RB#38	21.22	PASS
Band41	15MHz	QPSK	39725	1RB#74	21.79	PASS
Band41	15MHz	16QAM	39725	1RB#74	21.27	PASS
Band41	15MHz	QPSK	39725	38RB#0	20.82	PASS
Band41	15MHz	16QAM	39725	38RB#0	20.82	PASS
Band41	15MHz	QPSK	39725	38RB#18	20.82	PASS
Band41	15MHz	16QAM	39725	38RB#18	20.81	PASS
Band41	15MHz	QPSK	39725	38RB#37	20.81	PASS
Band41	15MHz	16QAM	39725	38RB#37	20.81	PASS
Band41	15MHz	QPSK	39725	75RB#0	20.81	PASS
Band41	15MHz	16QAM	39725	75RB#0	20.22	PASS
Band41	15MHz	QPSK	40620	1RB#0	22.32	PASS
Band41	15MHz	16QAM	40620	1RB#0	22.24	PASS
Band41	15MHz	QPSK	40620	1RB#38	22.25	PASS
Band41	15MHz	16QAM	40620	1RB#38	22.22	PASS
Band41	15MHz	QPSK	40620	1RB#74	21.94	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.40	PASS
Band41	15MHz	QPSK	40620	38RB#0	20.99	PASS
Band41	15MHz	16QAM	40620	38RB#0	20.99	PASS
Band41	15MHz	QPSK	40620	38RB#18	20.99	PASS
Band41	15MHz	16QAM	40620	38RB#18	20.99	PASS
Band41	15MHz	QPSK	40620	38RB#37	20.99	PASS
Band41	15MHz	16QAM	40620	38RB#37	20.99	PASS
Band41	15MHz	QPSK	40620	75RB#0	20.99	PASS
Band41	15MHz	16QAM	40620	75RB#0	20.44	PASS
Band41	15MHz	QPSK	41515	1RB#0	21.66	PASS
Band41	15MHz	16QAM	41515	1RB#0	21.43	PASS
Band41	15MHz	QPSK	41515	1RB#38	21.63	PASS





Band41	15MHz	16QAM	41515	1RB#38	21.45	PASS
Band41	15MHz	QPSK	41515	1RB#74	21.73	PASS
Band41	15MHz	16QAM	41515	1RB#74	21.42	PASS
Band41	15MHz	QPSK	41515	38RB#0	20.62	PASS
Band41	15MHz	16QAM	41515	38RB#0	20.62	PASS
Band41	15MHz	QPSK	41515	38RB#18	20.62	PASS
Band41	15MHz	16QAM	41515	38RB#18	20.62	PASS
Band41	15MHz	QPSK	41515	38RB#37	20.44	PASS
Band41	15MHz	16QAM	41515	38RB#37	20.44	PASS
Band41	15MHz	QPSK	41515	75RB#0	20.44	PASS
Band41	15MHz	16QAM	41515	75RB#0	19.83	PASS
Band41	20MHz	QPSK	39750	1RB#0	21.73	PASS
Band41	20MHz	16QAM	39750	1RB#0	21.26	PASS
Band41	20MHz	QPSK	39750	1RB#49	21.82	PASS
Band41	20MHz	16QAM	39750	1RB#49	21.28	PASS
Band41	20MHz	QPSK	39750	1RB#99	21.85	PASS
Band41	20MHz	16QAM	39750	1RB#99	21.42	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.14	PASS
Band41	20MHz	16QAM	39750	50RB#0	20.65	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.14	PASS
Band41	20MHz	16QAM	39750	50RB#25	20.65	PASS
Band41	20MHz	QPSK	39750	50RB#50	21.13	PASS
Band41	20MHz	16QAM	39750	50RB#50	20.70	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.16	PASS
Band41	20MHz	16QAM	39750	100RB#0	20.44	PASS
Band41	20MHz	QPSK	40620	1RB#0	21.93	PASS
Band41	20MHz	16QAM	40620	1RB#0	22.16	PASS
Band41	20MHz	QPSK	40620	1RB#49	21.82	PASS
Band41	20MHz	16QAM	40620	1RB#49	21.91	PASS
Band41	20MHz	QPSK	40620	1RB#99	21.89	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.90	PASS
Band41	20MHz	QPSK	40620	50RB#0	21.19	PASS
Band41	20MHz	16QAM	40620	50RB#0	20.68	PASS
Band41	20MHz	QPSK	40620	50RB#25	21.20	PASS
Band41	20MHz	16QAM	40620	50RB#25	20.68	PASS
Band41	20MHz	QPSK	40620	50RB#50	21.02	PASS
Band41	20MHz	16QAM	40620	50RB#50	20.42	PASS
Band41	20MHz	QPSK	40620	100RB#0	21.01	PASS
Band41	20MHz	16QAM	40620	100RB#0	20.47	PASS
Band41	20MHz	QPSK	41490	1RB#0	21.43	PASS





Band41	20MHz	16QAM	41490	1RB#0	21.56	PASS
Band41	20MHz	QPSK	41490	1RB#49	21.36	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.52	PASS
Band41	20MHz	QPSK	41490	1RB#99	21.35	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.53	PASS
Band41	20MHz	QPSK	41490	50RB#0	20.67	PASS
Band41	20MHz	16QAM	41490	50RB#0	19.95	PASS
Band41	20MHz	QPSK	41490	50RB#25	20.61	PASS
Band41	20MHz	16QAM	41490	50RB#25	19.95	PASS
Band41	20MHz	QPSK	41490	50RB#50	20.52	PASS
Band41	20MHz	16QAM	41490	50RB#50	19.99	PASS
Band41	20MHz	QPSK	41490	100RB#0	20.51	PASS
Band41	20MHz	16QAM	41490	100RB#0	19.95	PASS





Q.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.29	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.82	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	9.06	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.54	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.70	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	8.82	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.00	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.61	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	8.22	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	8.73	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	9.01	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	9.70	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	8.17	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	9.01	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.25	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.52	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.44	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.31	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.20	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.58	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.39	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.85	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.27	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.65	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.24	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.49	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	9.06	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.85	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.25	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	8.85	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.29	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.92	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.21	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	8.67	13	PASS
Band41	15MHz	QPSK	41515	75RB#0	9.42	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	15MHz	16QAM	41515	75RB#0	9.82	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	8.06	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.57	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	9.20	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.84	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.31	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	8.82	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.37	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.66	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.00	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.07	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.99	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.85	13	PASS





Test Graphs




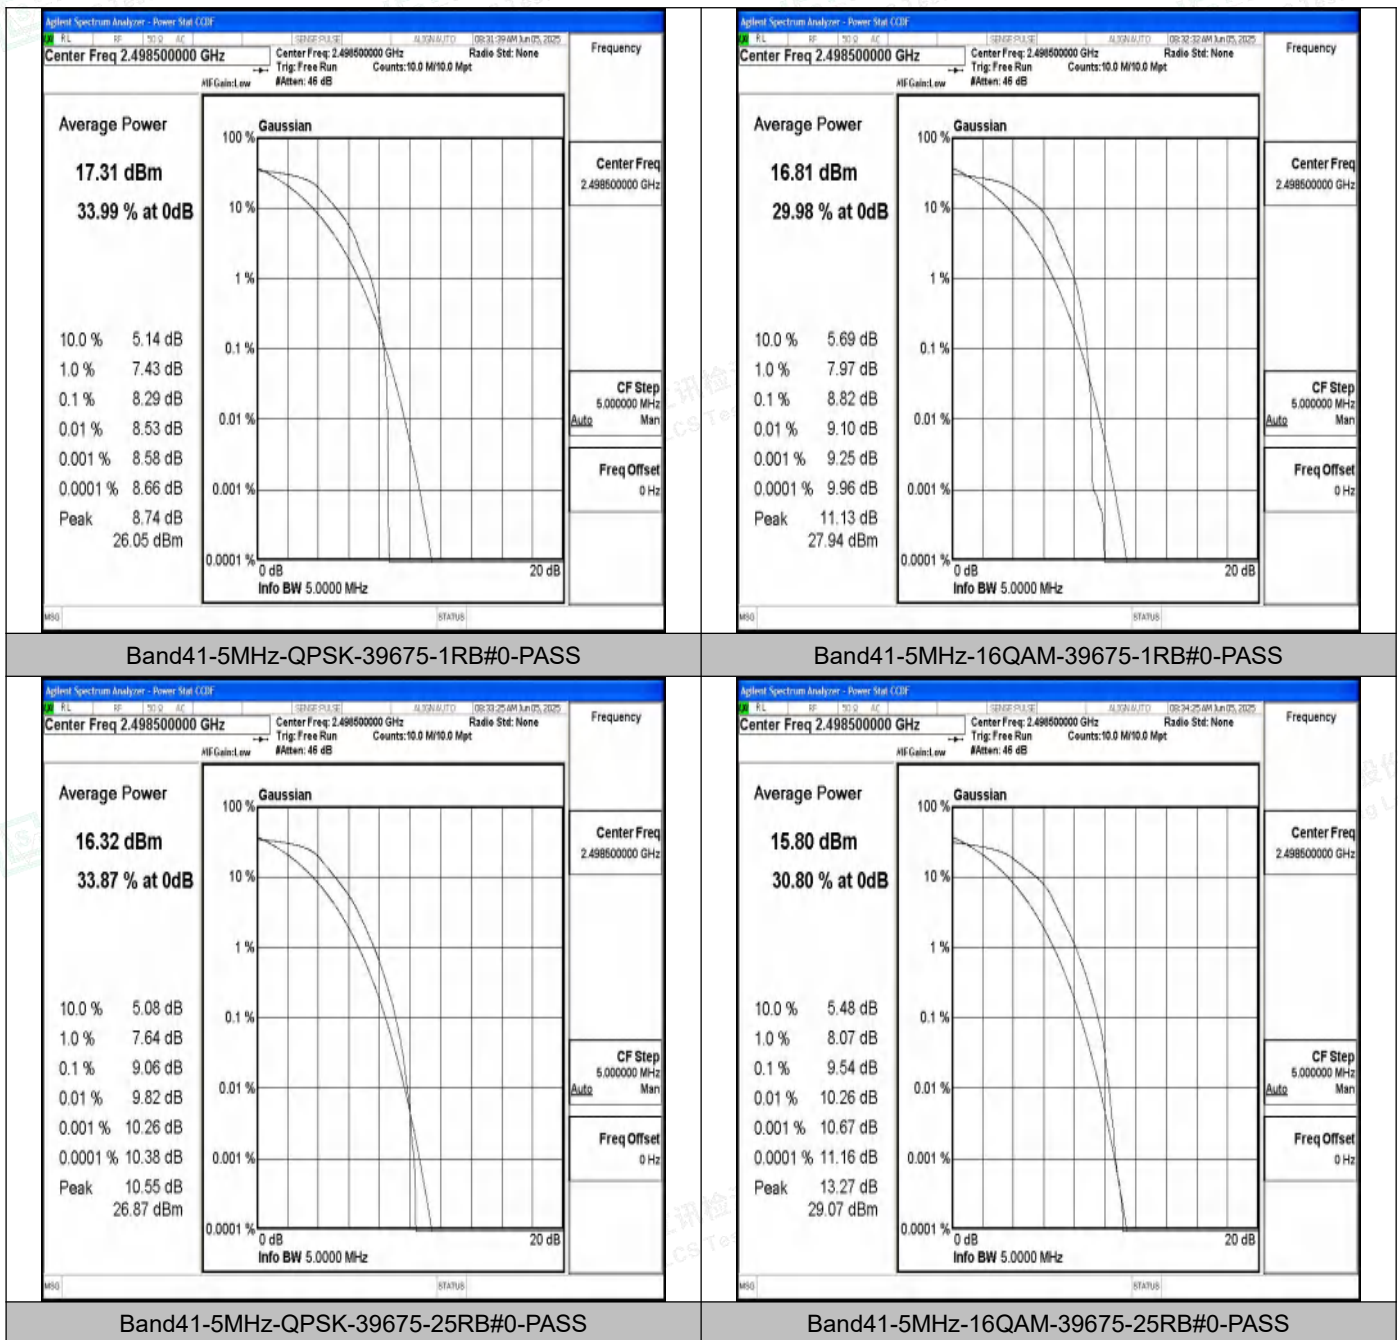


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

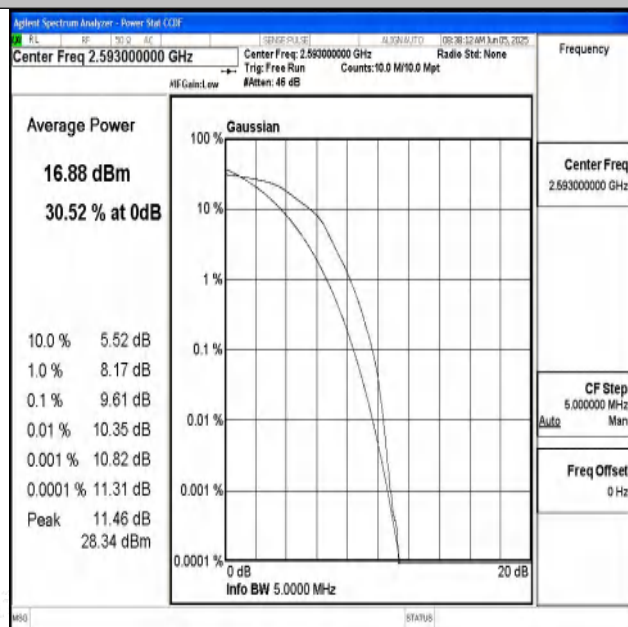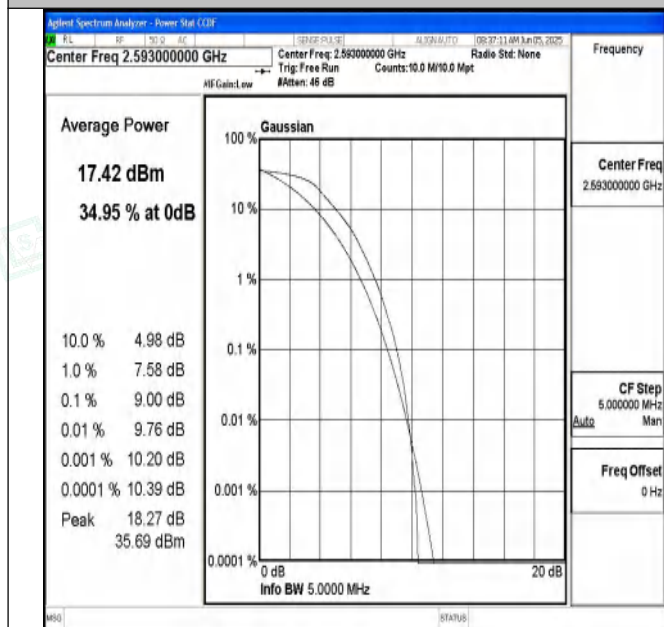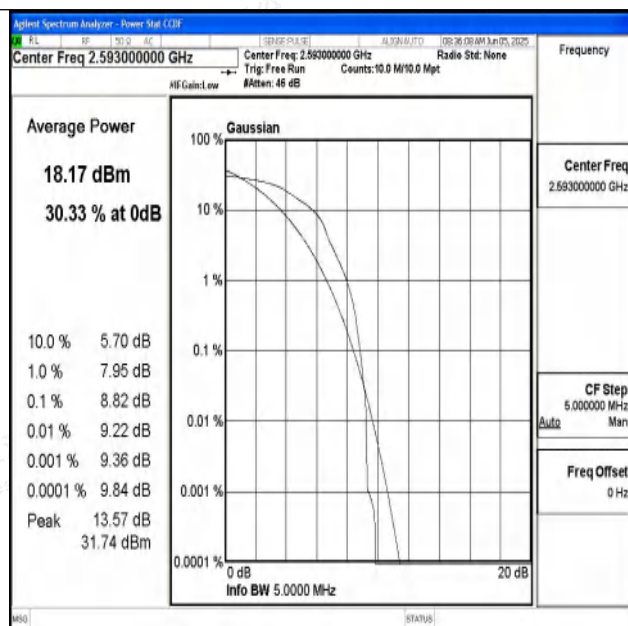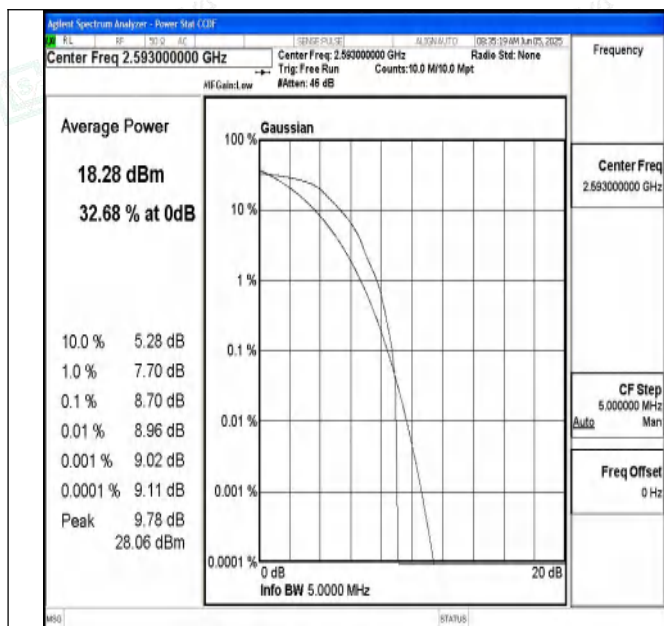


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

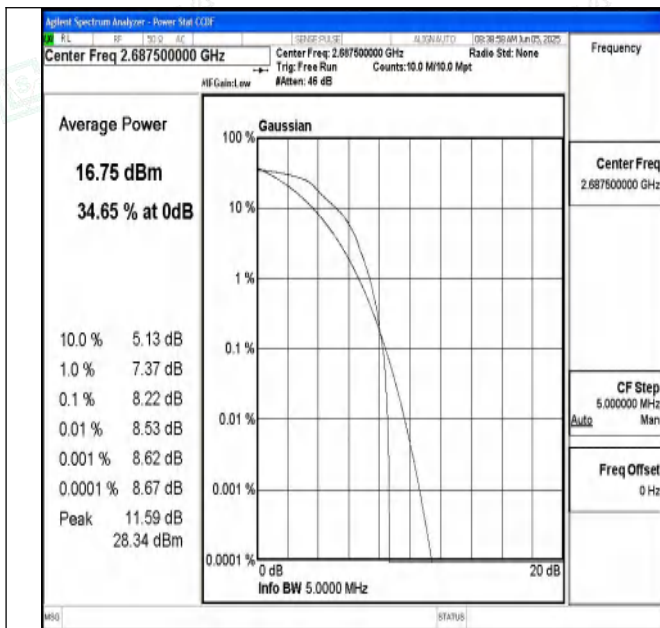


Band41-5MHz-QPSK-41565-1RB#0-PASS

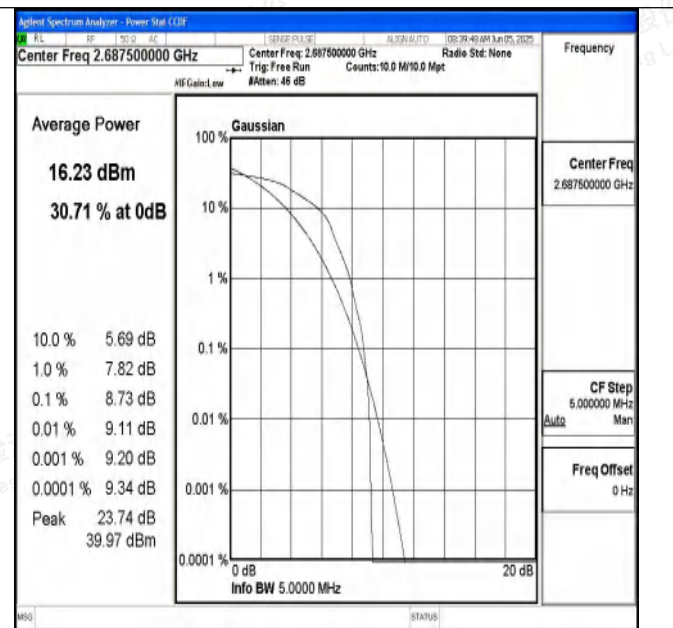

Band41-5MHz-16QAM-41565-1RB#0-PASS

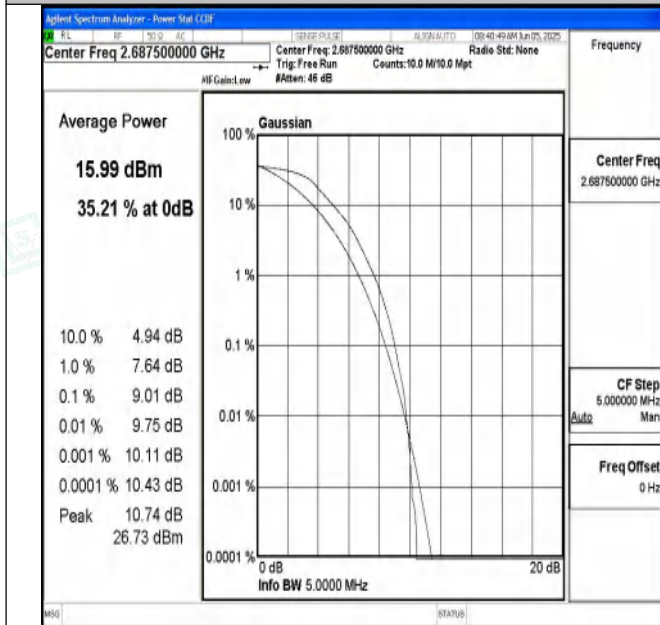

Band41-5MHz-QPSK-41565-25RB#0-PASS

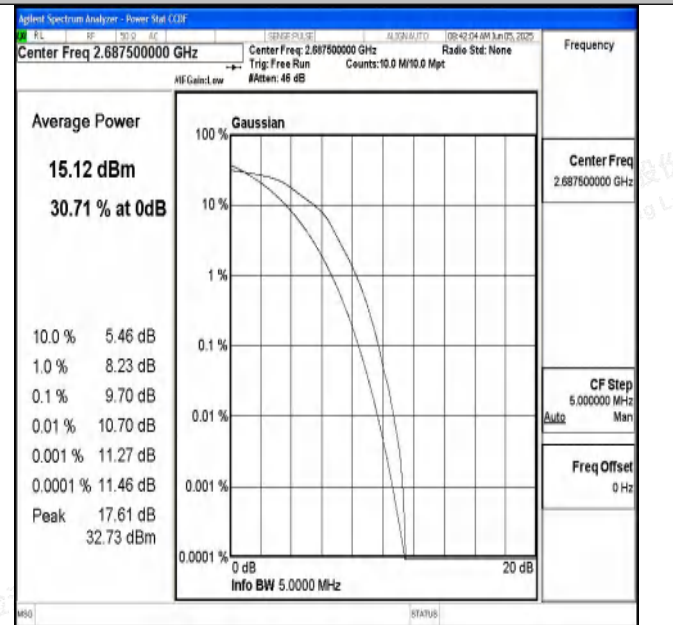

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

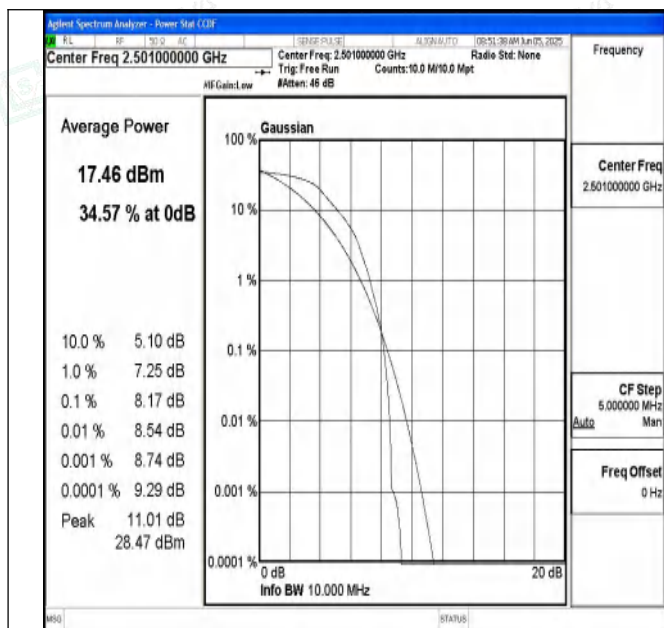


Band41-10MHz-QPSK-39700-1RB#0-PASS

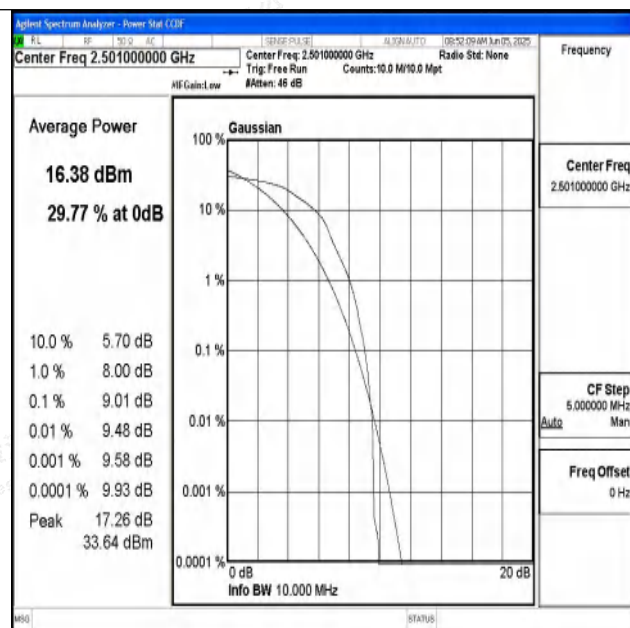

Band41-10MHz-16QAM-39700-1RB#0-PASS

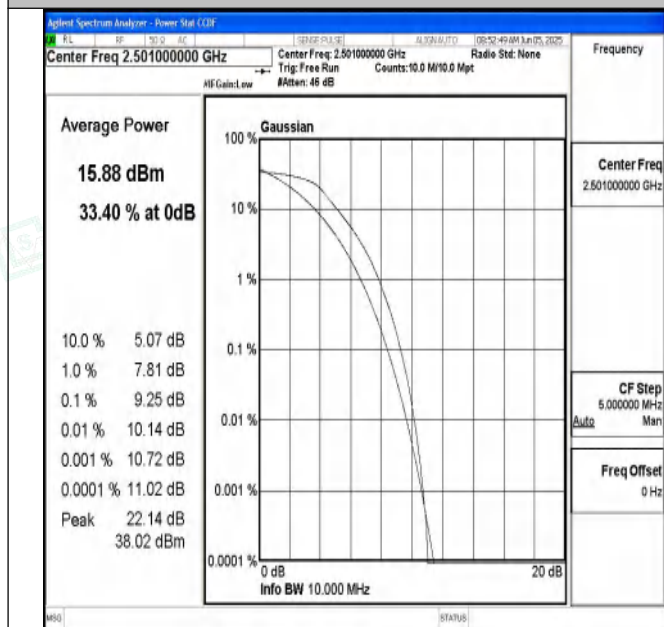


Band41-10MHz-QPSK-39700-50RB#0-PASS

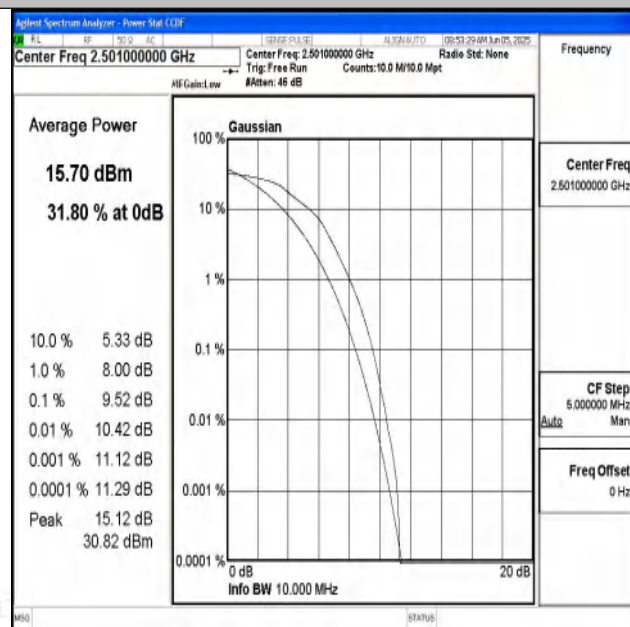


Band41-10MHz-16QAM-39700-50RB#0-PASS




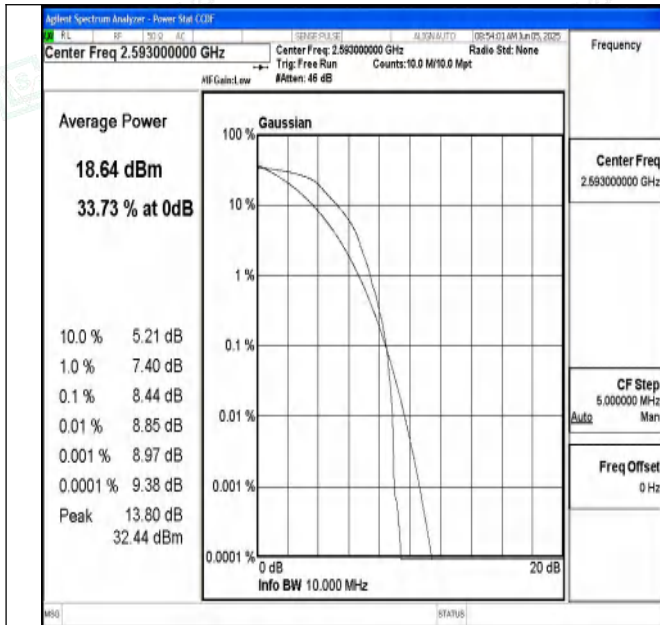


Band41-10MHz-QPSK-40620-1RB#0-PASS

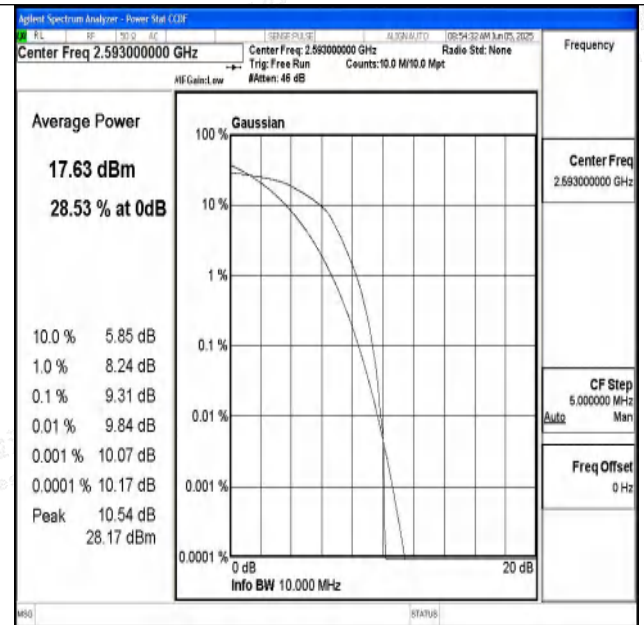

Band41-10MHz-16QAM-40620-1RB#0-PASS

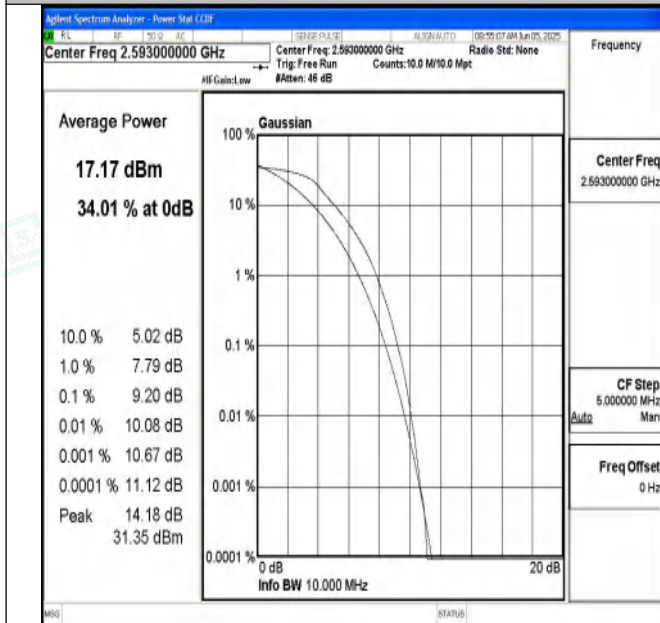

Band41-10MHz-QPSK-40620-50RB#0-PASS

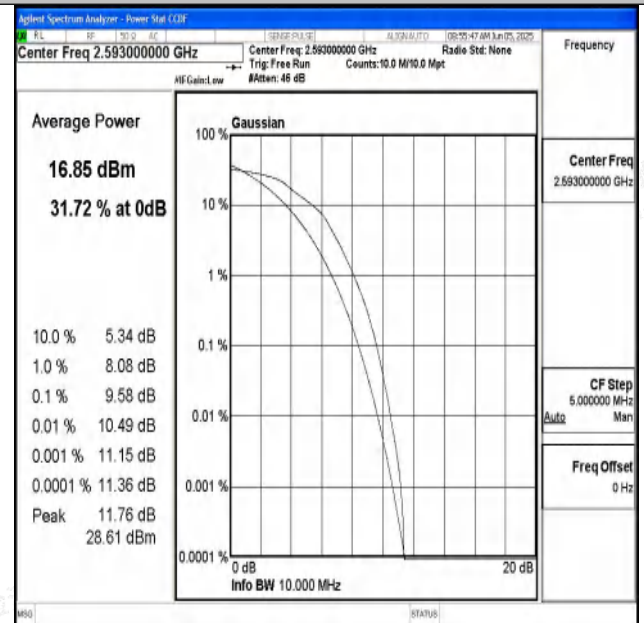

Band41-10MHz-16QAM-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

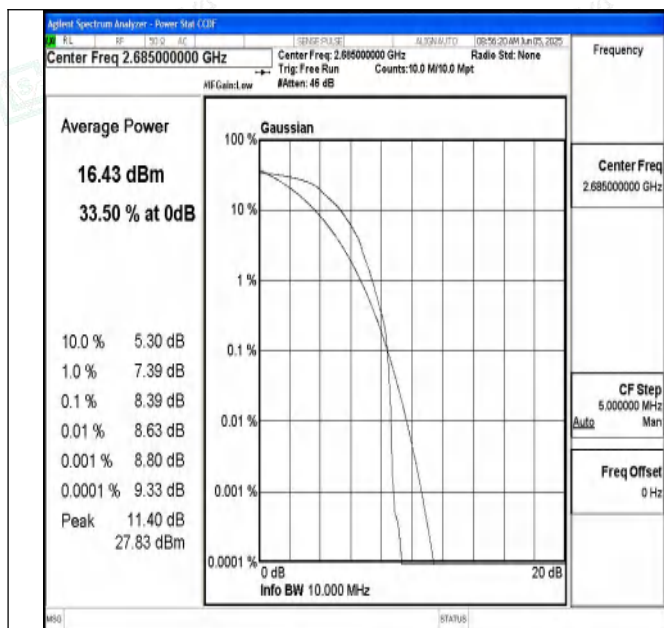


Band41-10MHz-QPSK-41540-1RB#0-PASS

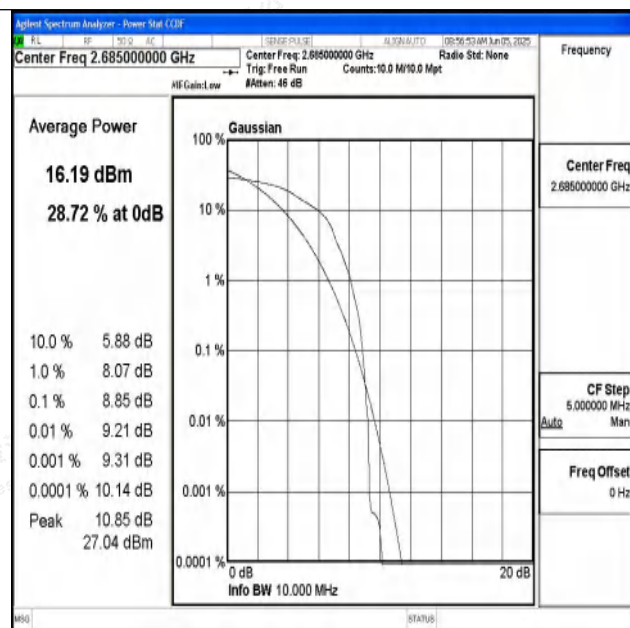

Band41-10MHz-16QAM-41540-1RB#0-PASS




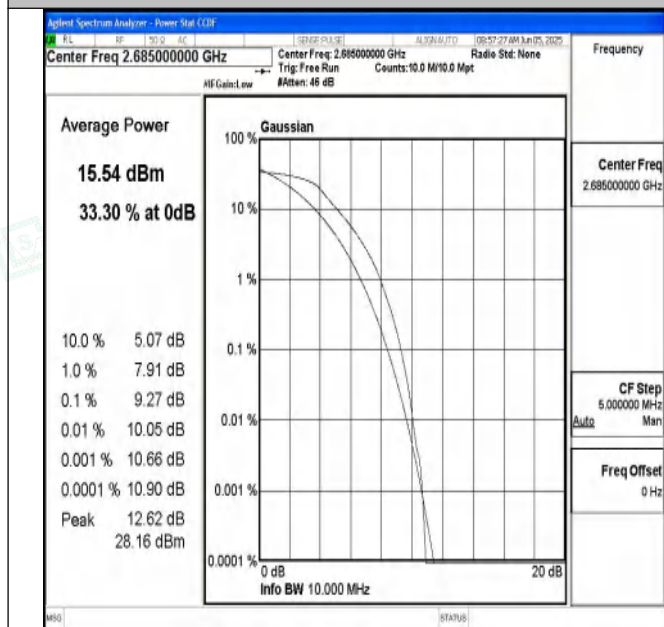


Band41-10MHz-QPSK-41540-50RB#0-PASS

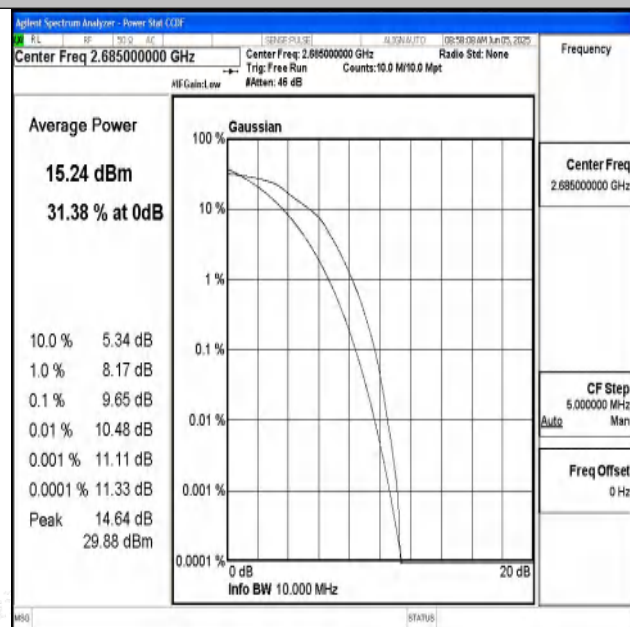

Band41-10MHz-16QAM-41540-50RB#0-PASS



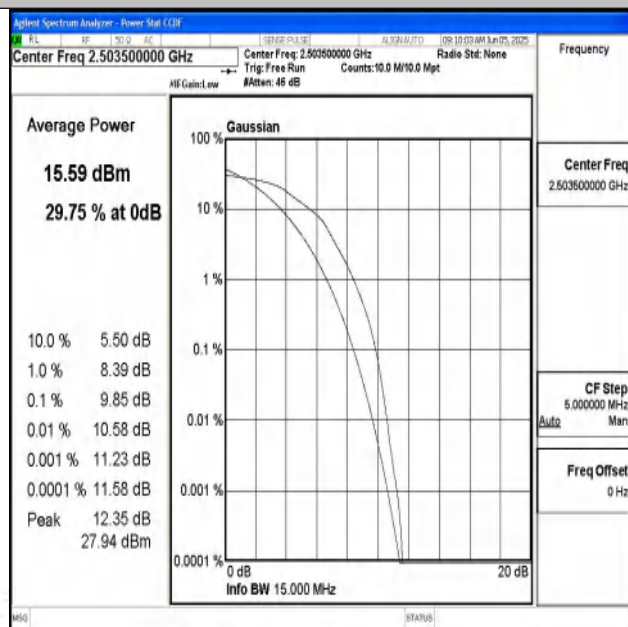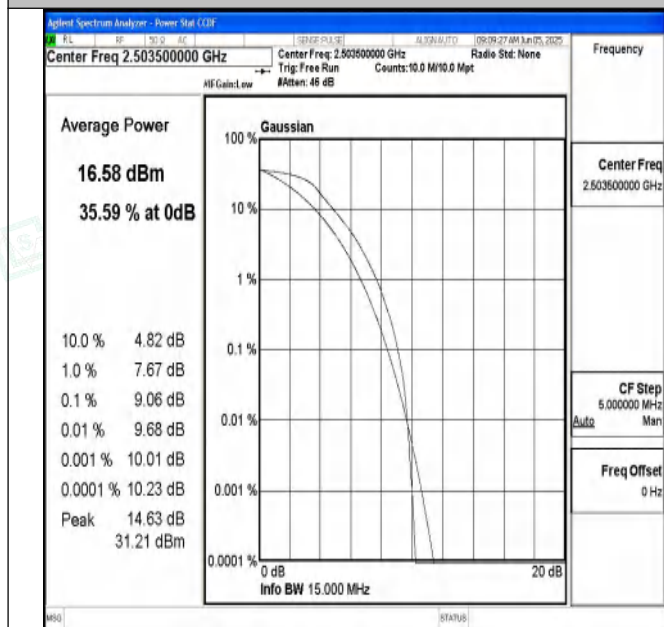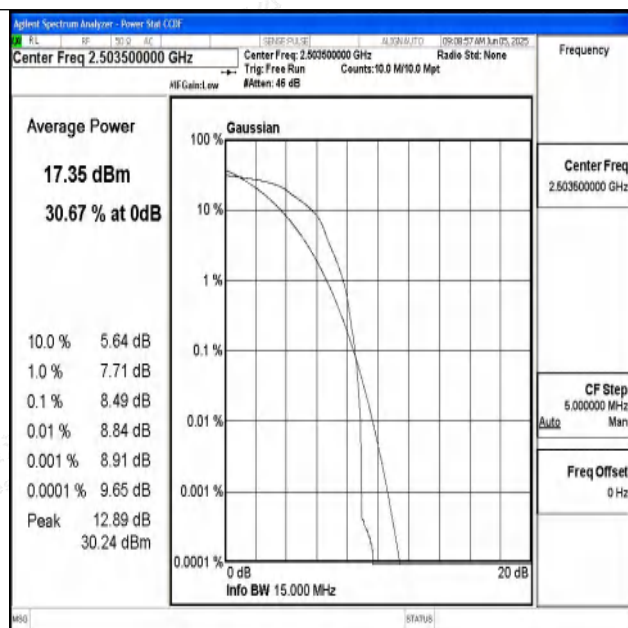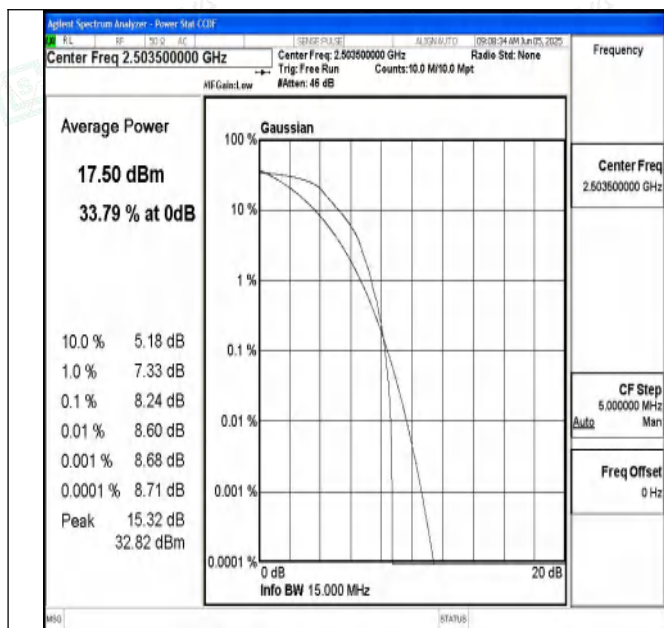


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

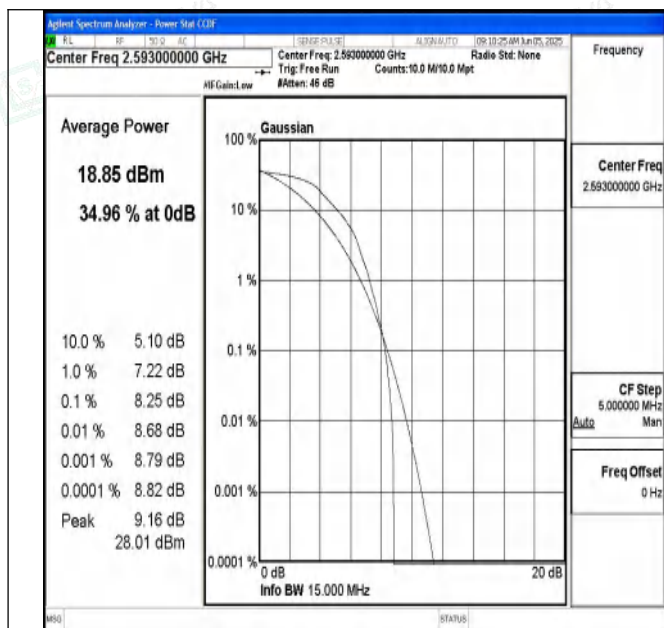


Band41-15MHz-QPSK-40620-1RB#0-PASS

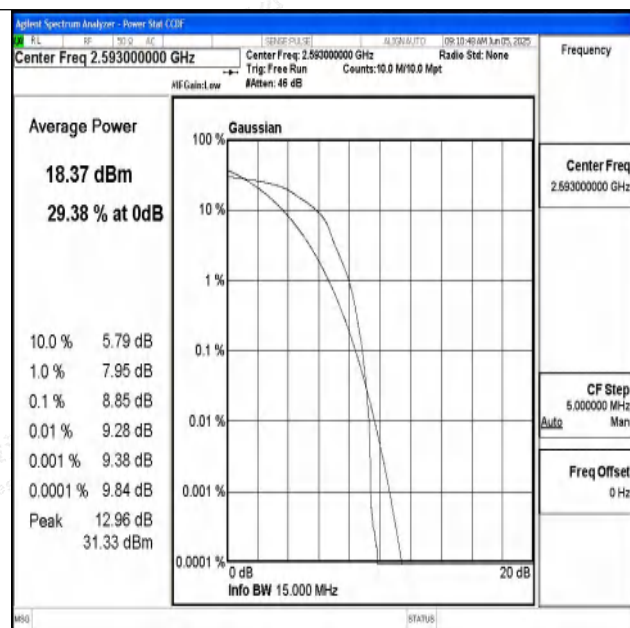

Band41-15MHz-16QAM-40620-1RB#0-PASS




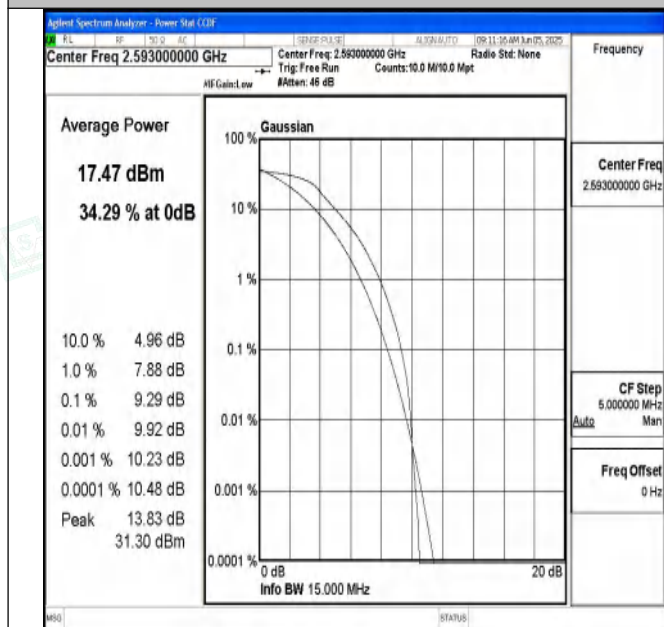


Band41-15MHz-QPSK-40620-75RB#0-PASS

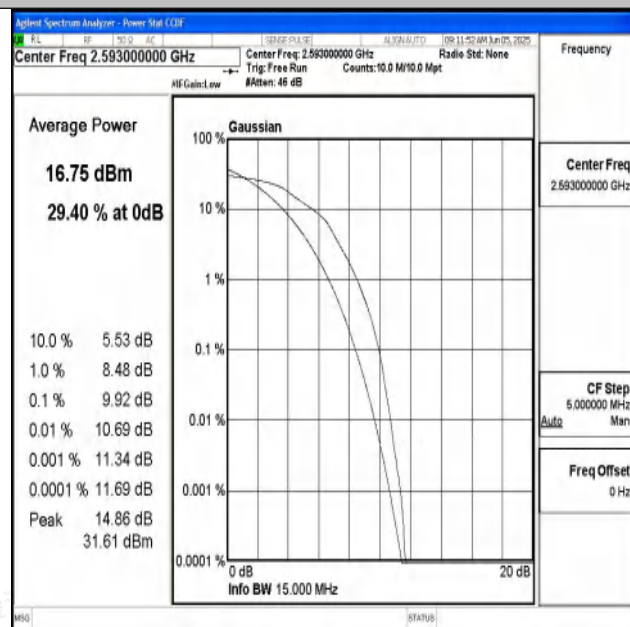

Band41-15MHz-16QAM-40620-75RB#0-PASS



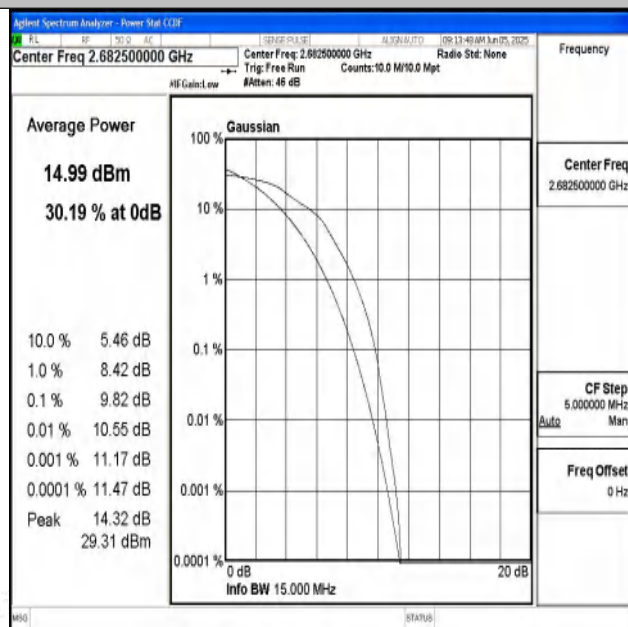
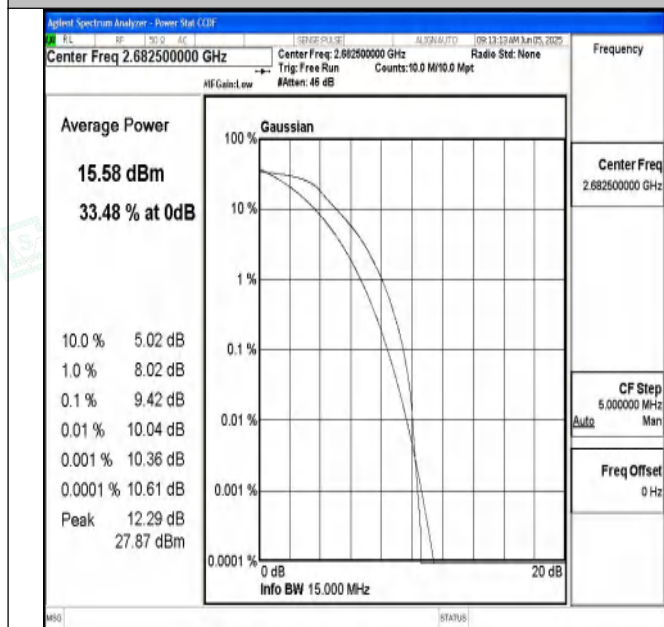
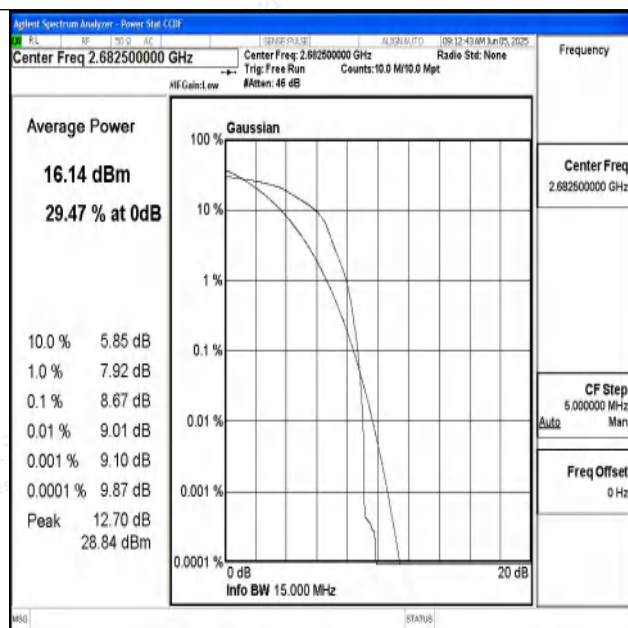
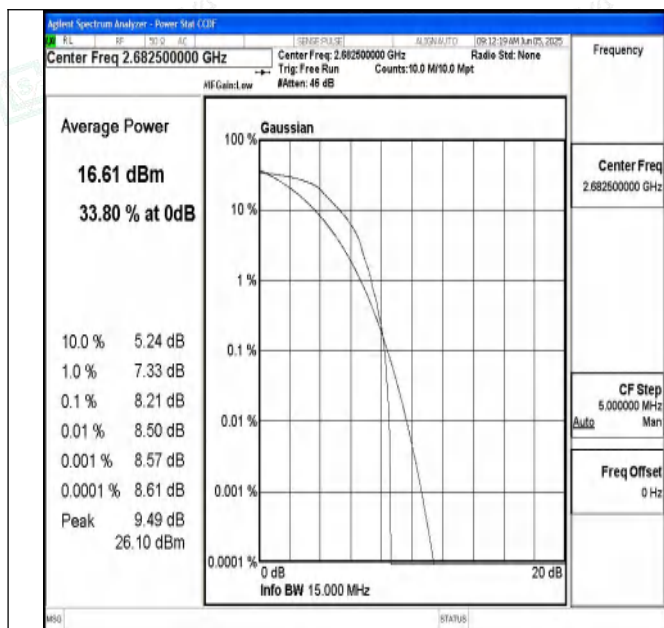


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

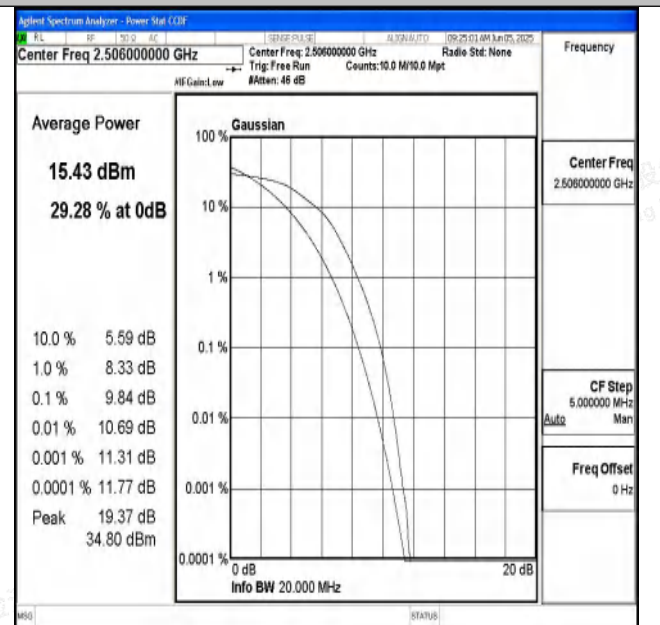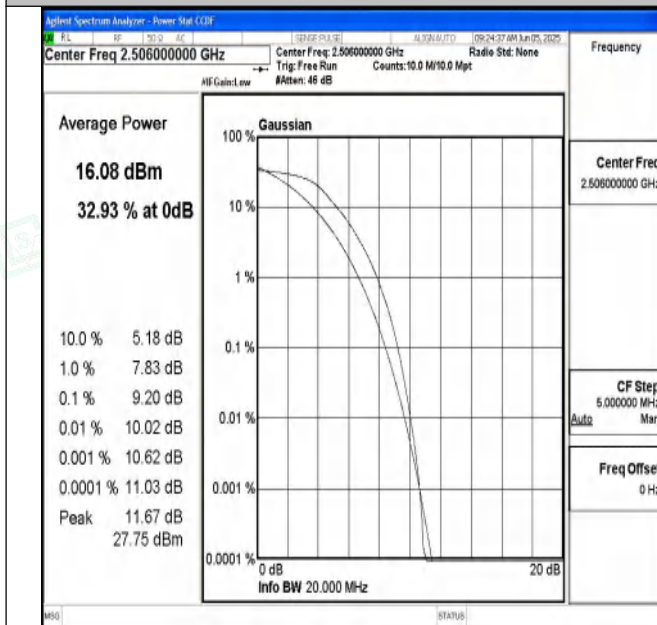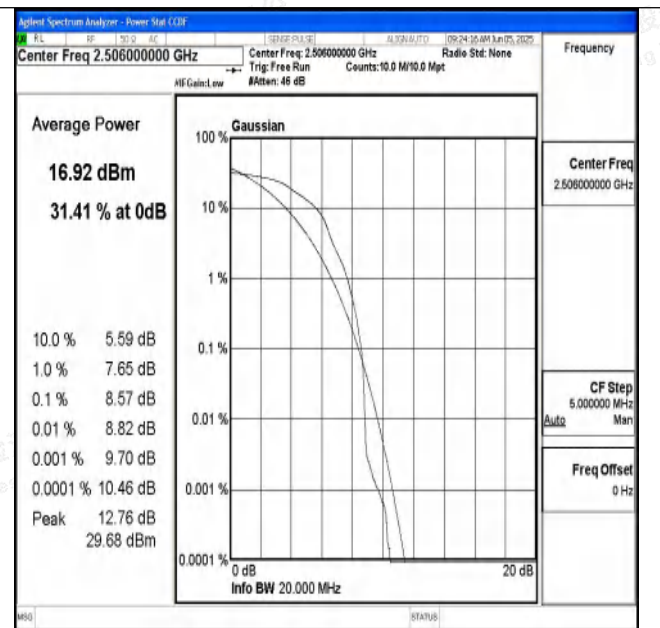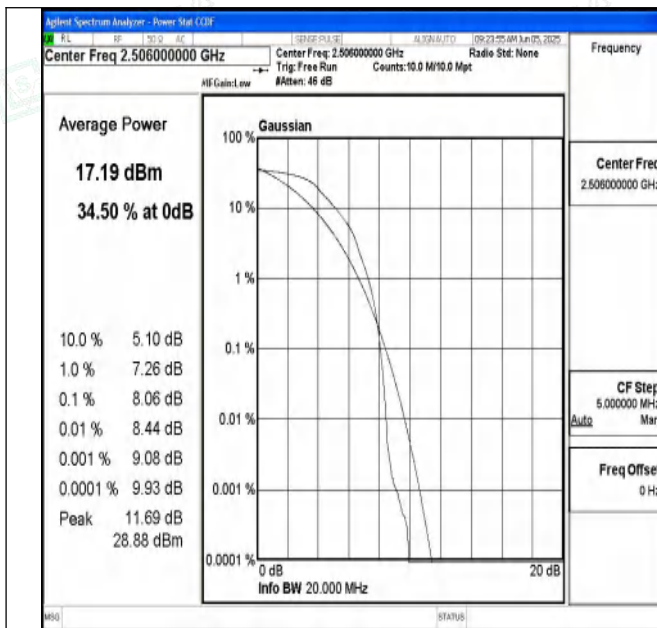


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

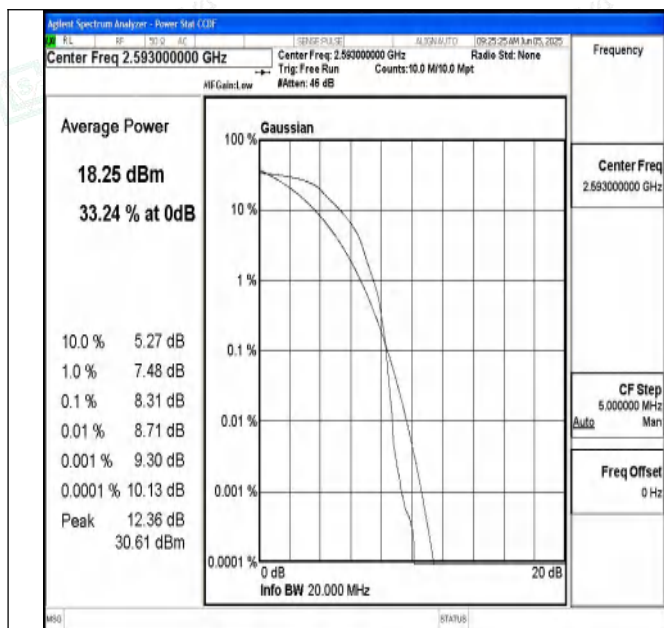


Band41-20MHz-QPSK-40620-1RB#0-PASS

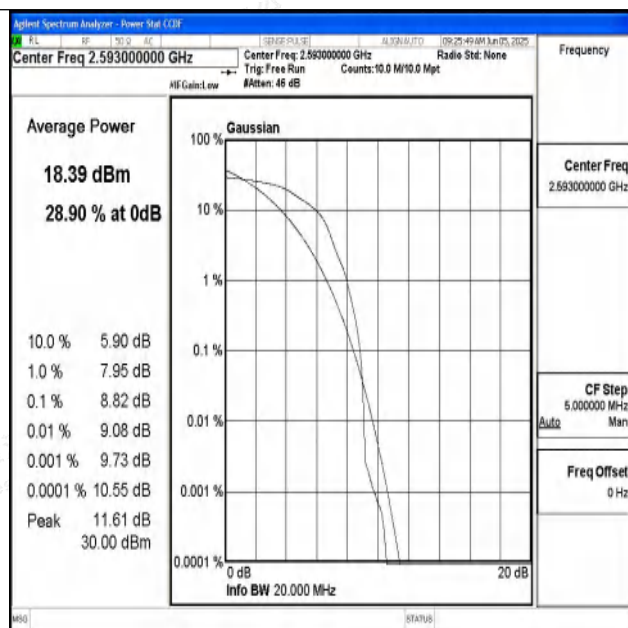

Band41-20MHz-16QAM-40620-1RB#0-PASS

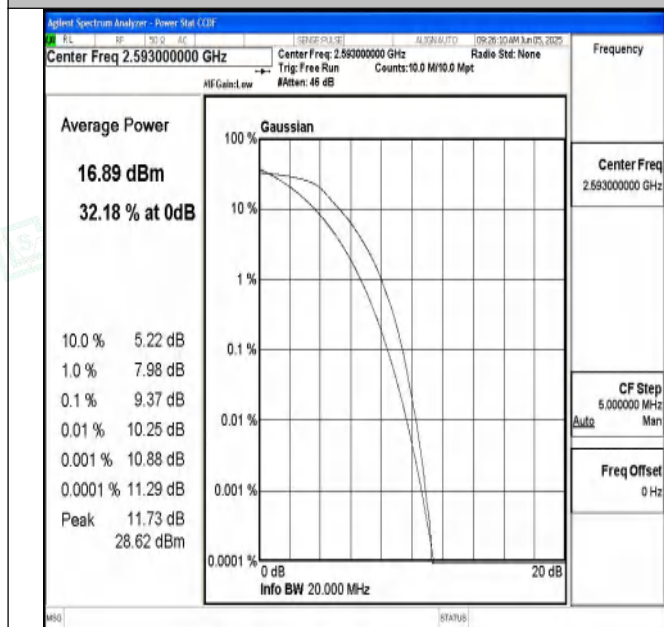

Band41-20MHz-QPSK-40620-100RB#0-PASS

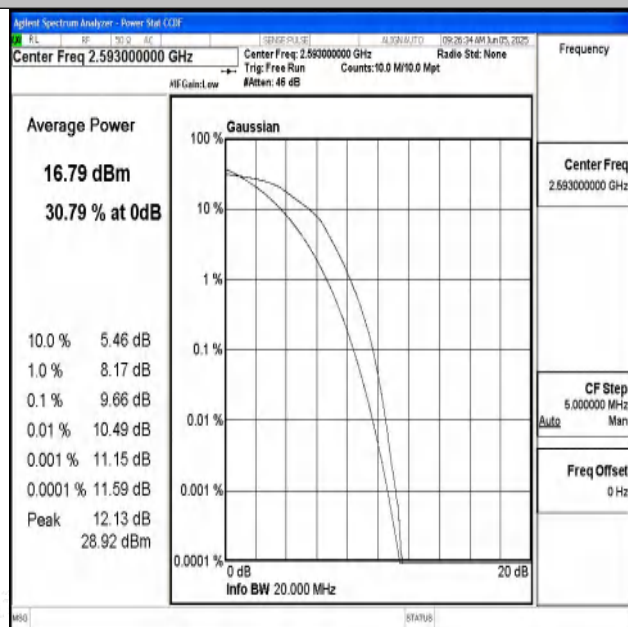

Band41-20MHz-16QAM-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

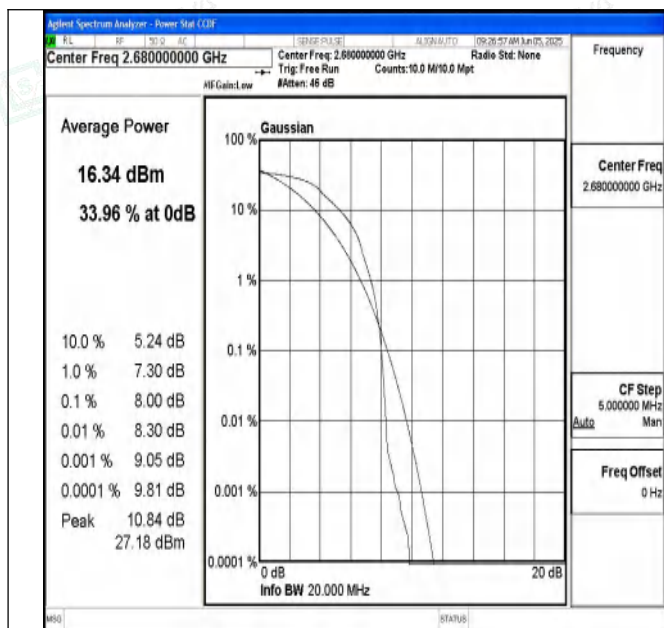


Band41-20MHz-QPSK-41490-1RB#0-PASS

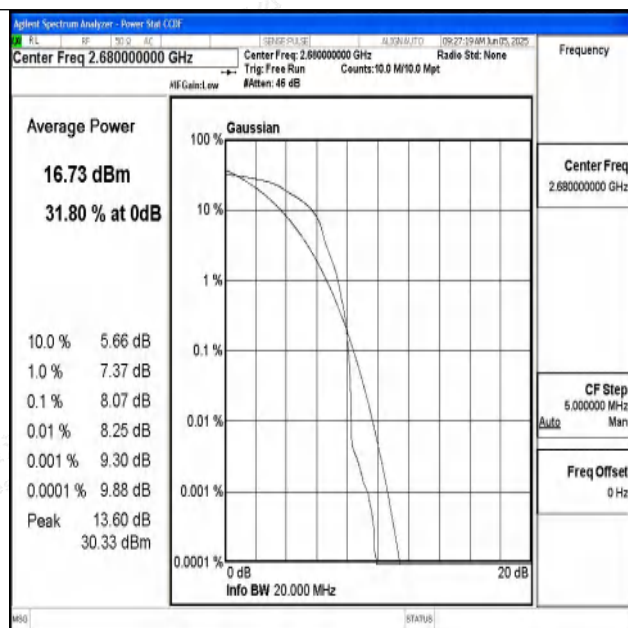

Band41-20MHz-16QAM-41490-1RB#0-PASS

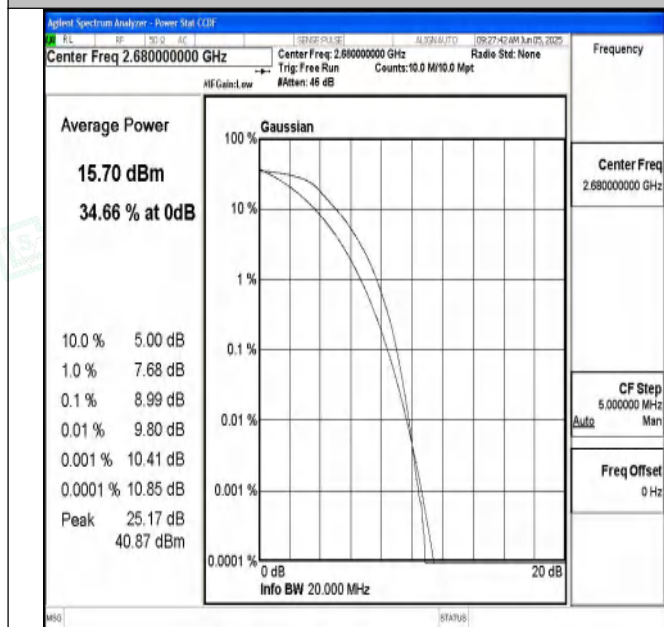

Band41-20MHz-QPSK-41490-100RB#0-PASS

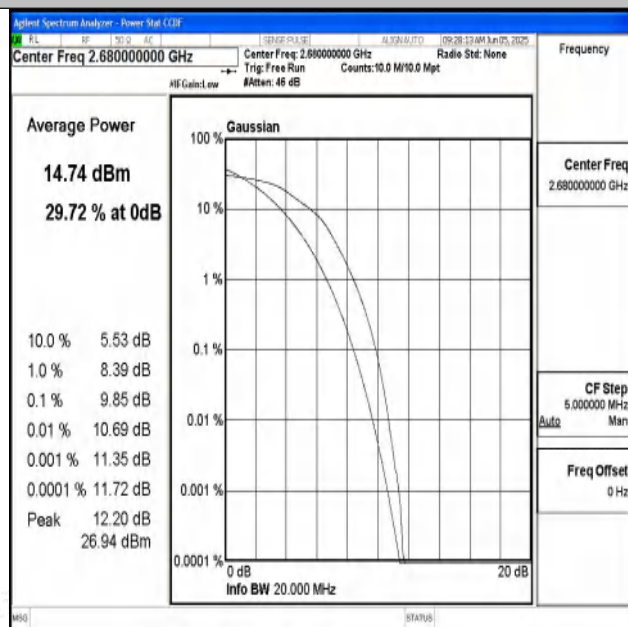

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Q.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5034	5.296	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5060	5.421	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5035	5.110	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5004	5.310	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4986	5.144	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5037	5.312	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9825	10.12	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.0004	10.08	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0022	10.07	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9846	10.17	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.0197	10.29	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.0063	10.98	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.531	16.57	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.487	15.18	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.494	16.22	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.514	15.29	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.506	15.07	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.497	15.32	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.908	19.94	PASS
Band41	20MHz	16QAM	39750	100RB#0	17.892	20.57	PASS
Band41	20MHz	QPSK	40620	100RB#0	17.958	19.84	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.970	20.38	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.997	19.91	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.945	20.50	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Test Graphs

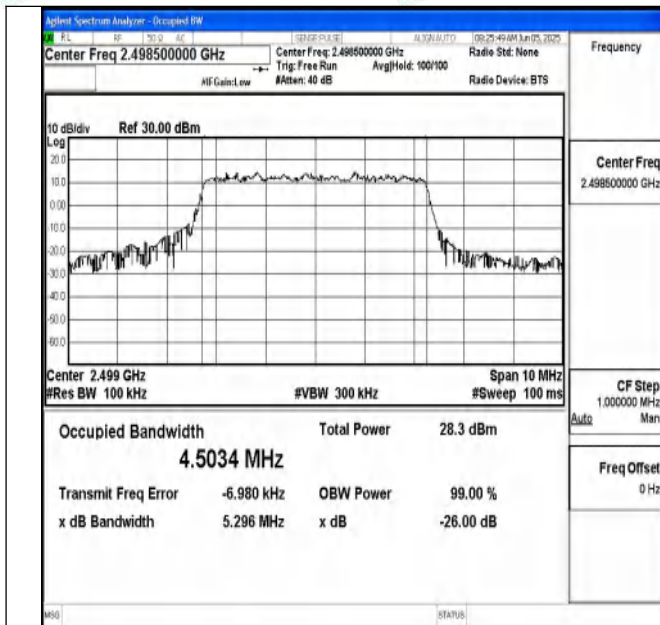


Band41-5MHz-QPSK-39675-25RB#0-PASS

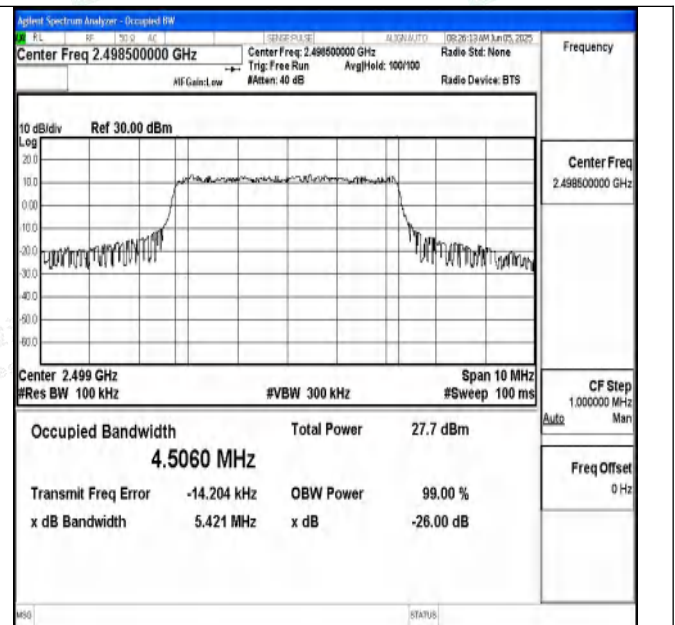

Band41-5MHz-16QAM-39675-25RB#0-PASS

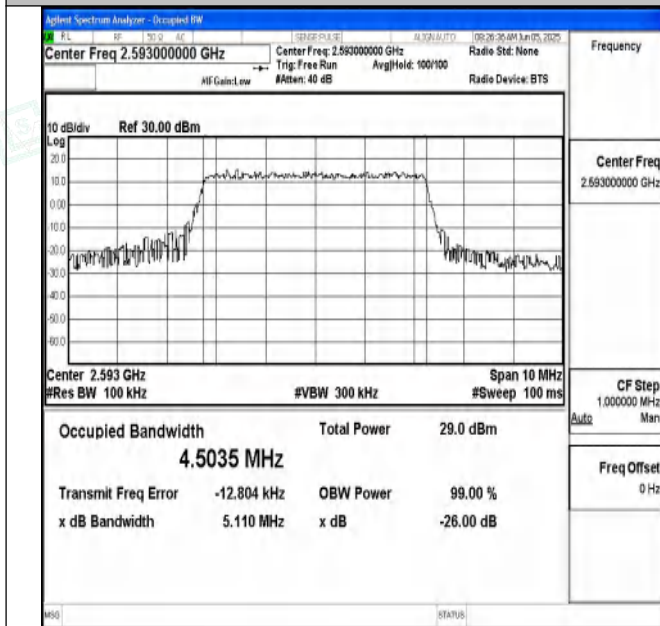

Band41-5MHz-QPSK-40620-25RB#0-PASS

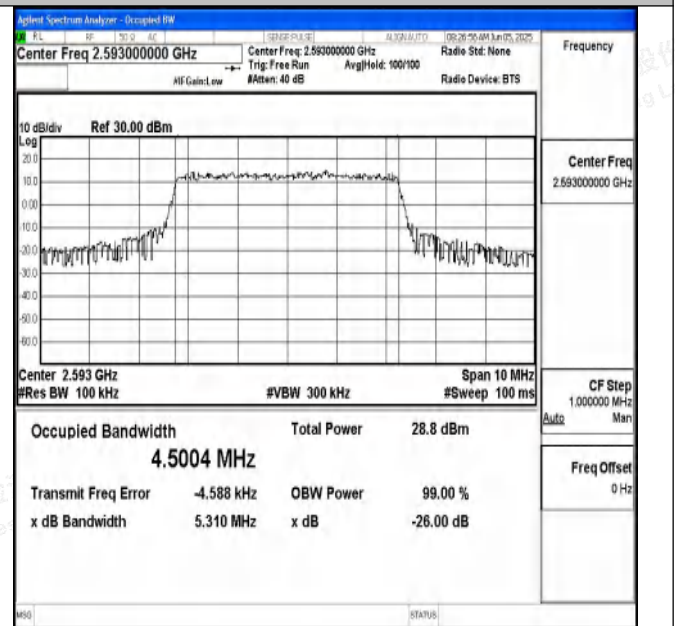

Band41-5MHz-16QAM-40620-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

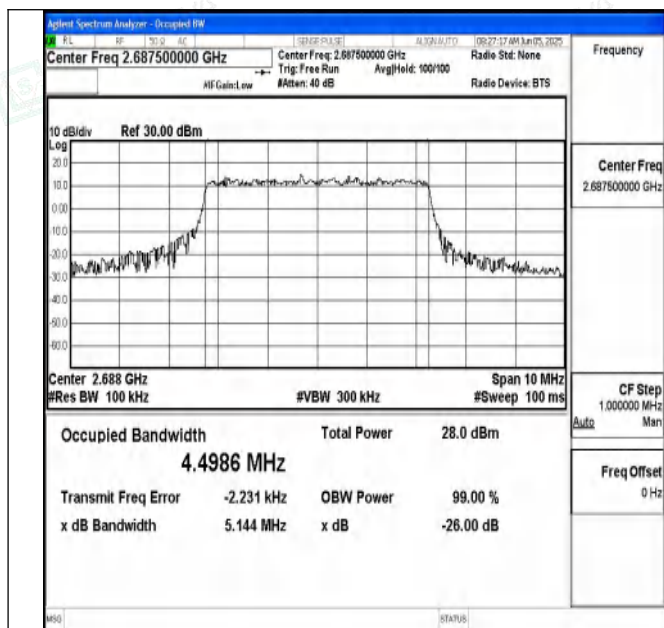


Band41-5MHz-QPSK-41565-25RB#0-PASS

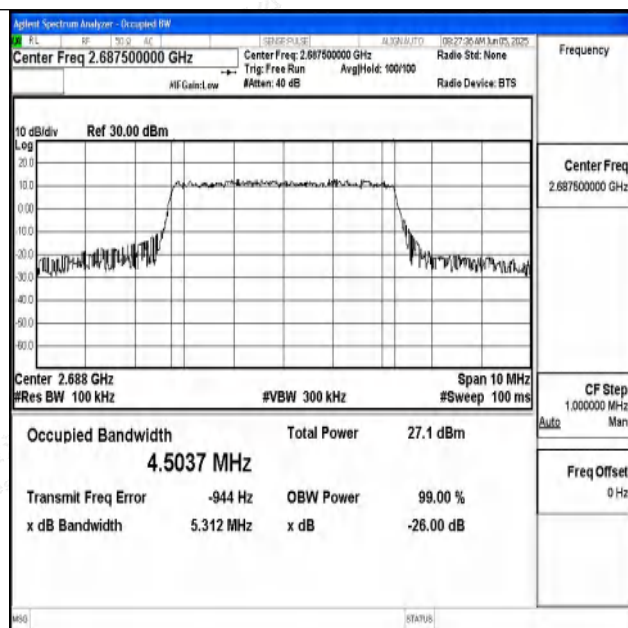

Band41-5MHz-16QAM-41565-25RB#0-PASS

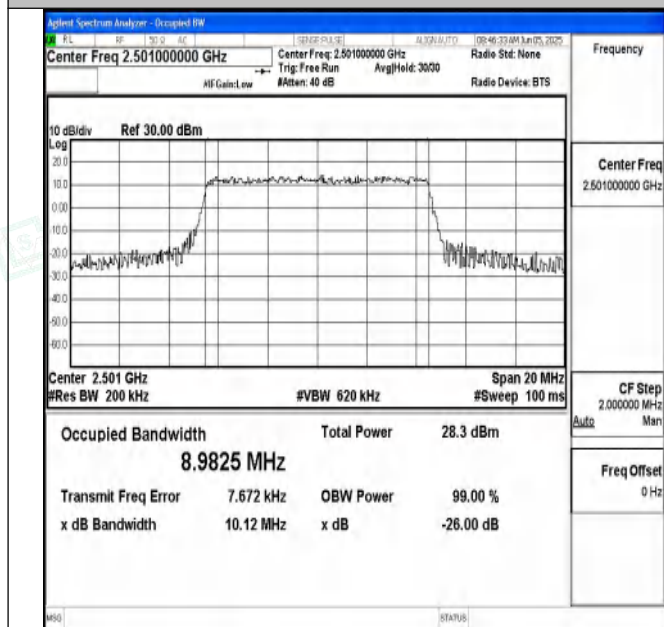

Band41-10MHz-QPSK-39700-50RB#0-PASS

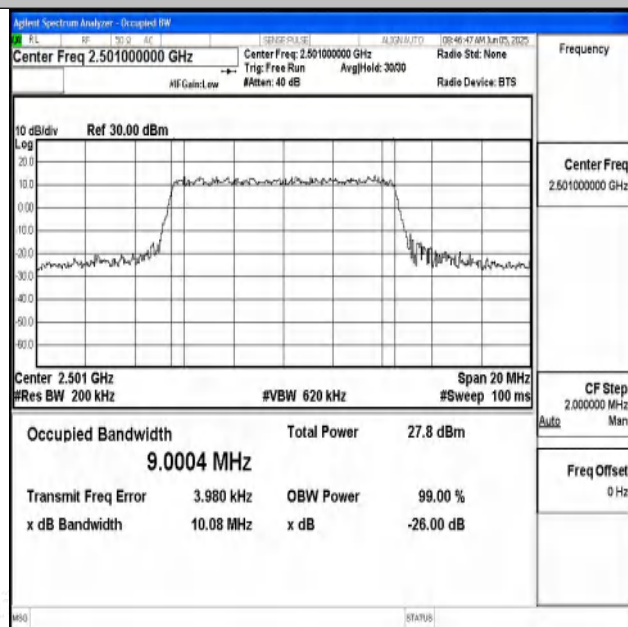

Band41-10MHz-16QAM-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

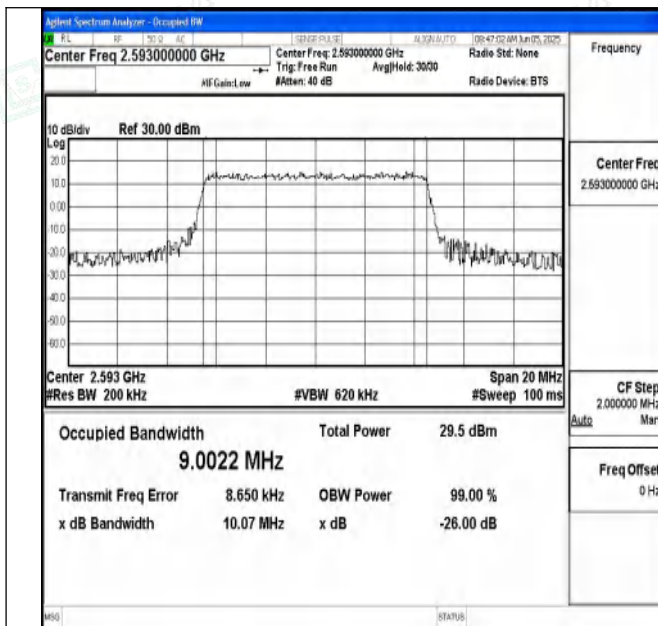


Band41-10MHz-QPSK-40620-50RB#0-PASS

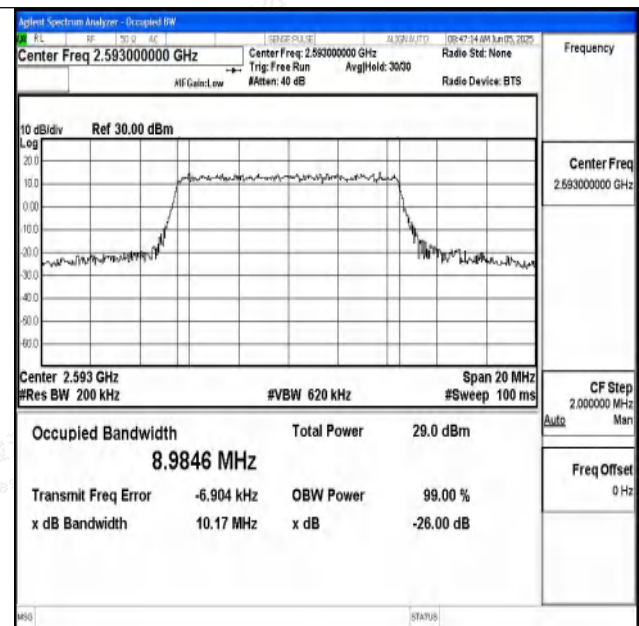

Band41-10MHz-16QAM-40620-50RB#0-PASS

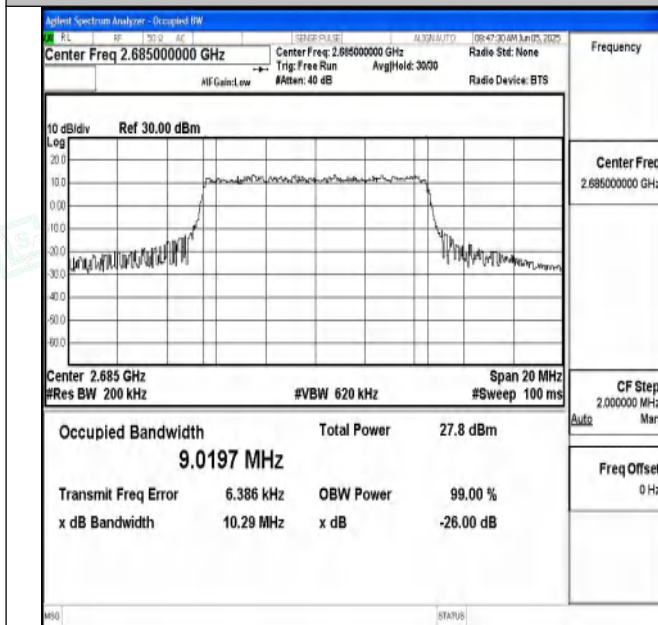

Band41-10MHz-QPSK-41540-50RB#0-PASS

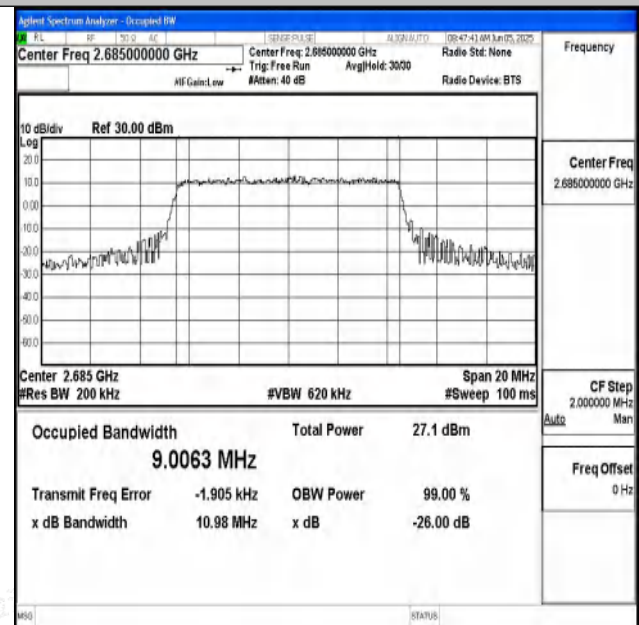

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

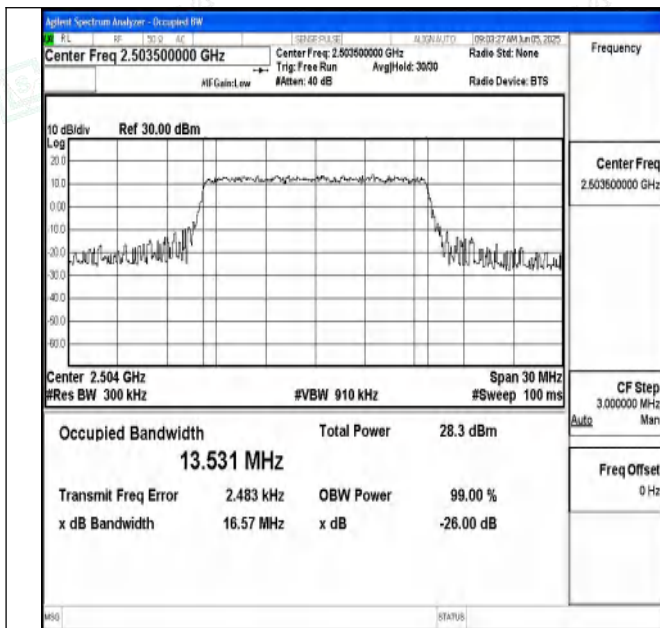


Band41-15MHz-QPSK-39725-75RB#0-PASS

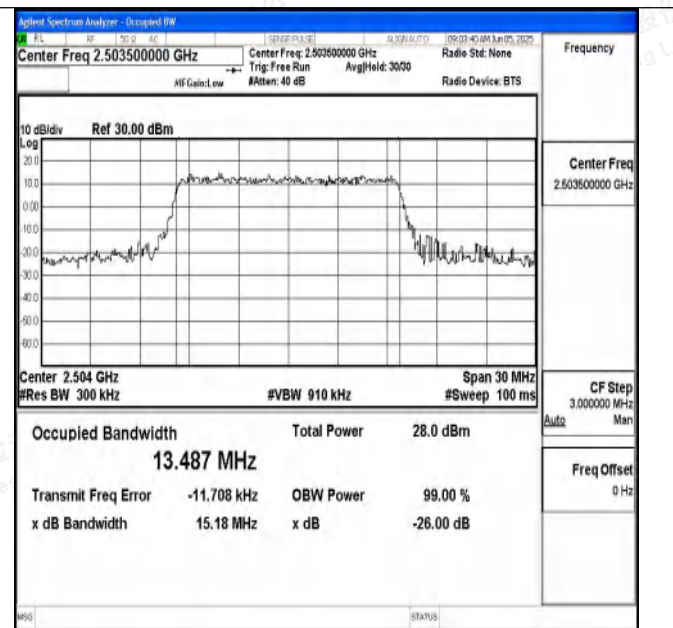

Band41-15MHz-16QAM-39725-75RB#0-PASS

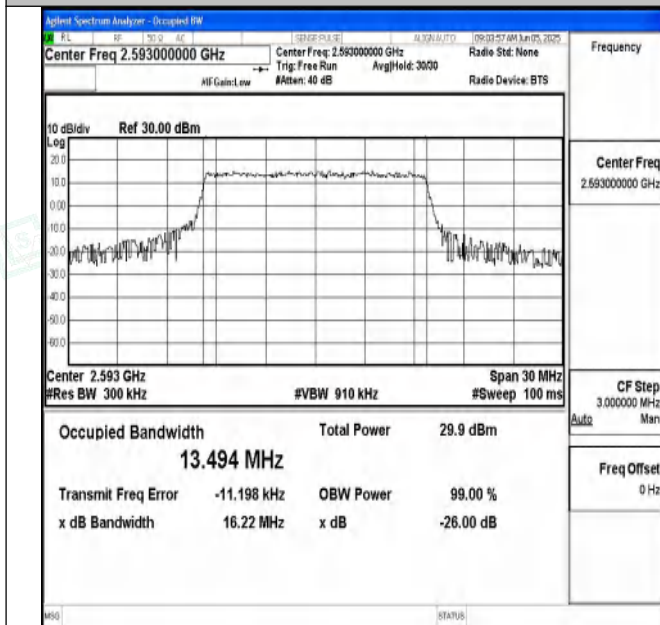

Band41-15MHz-QPSK-40620-75RB#0-PASS

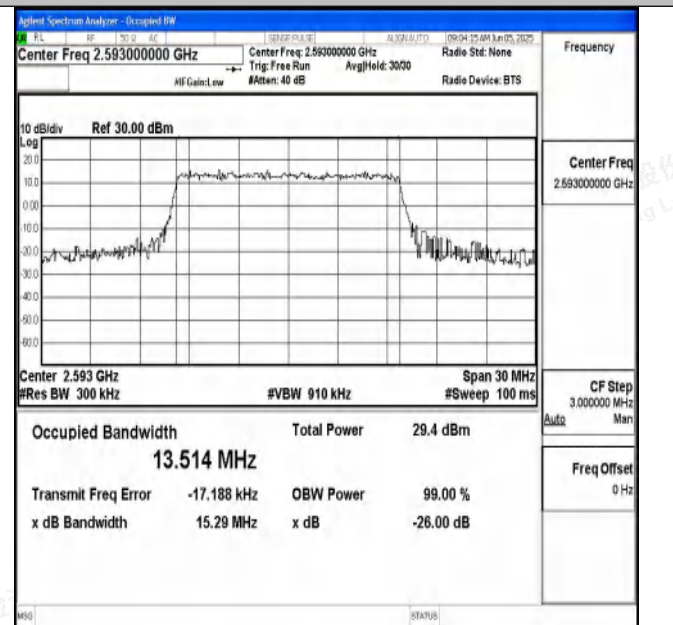

Band41-15MHz-16QAM-40620-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

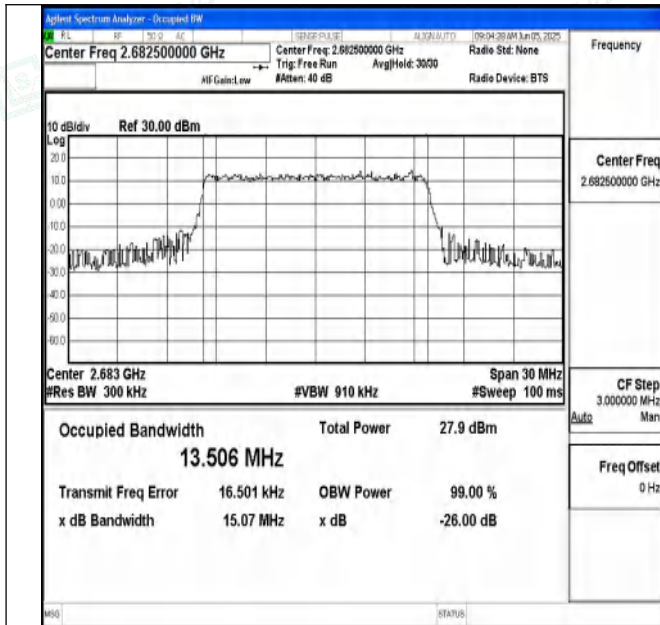


Band41-15MHz-QPSK-41515-75RB#0-PASS

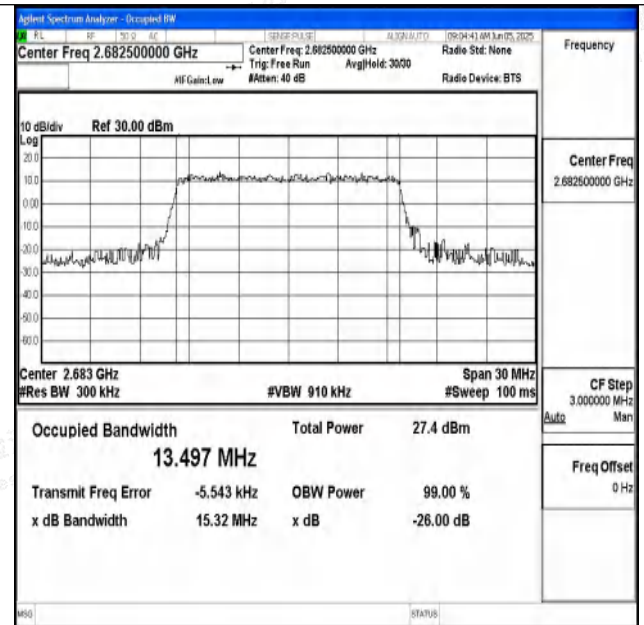

Band41-15MHz-16QAM-41515-75RB#0-PASS

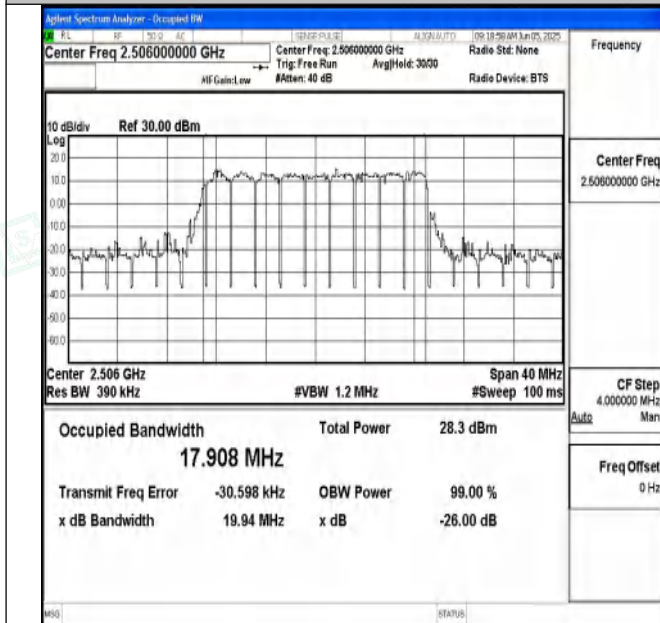

Band41-20MHz-QPSK-39750-100RB#0-PASS

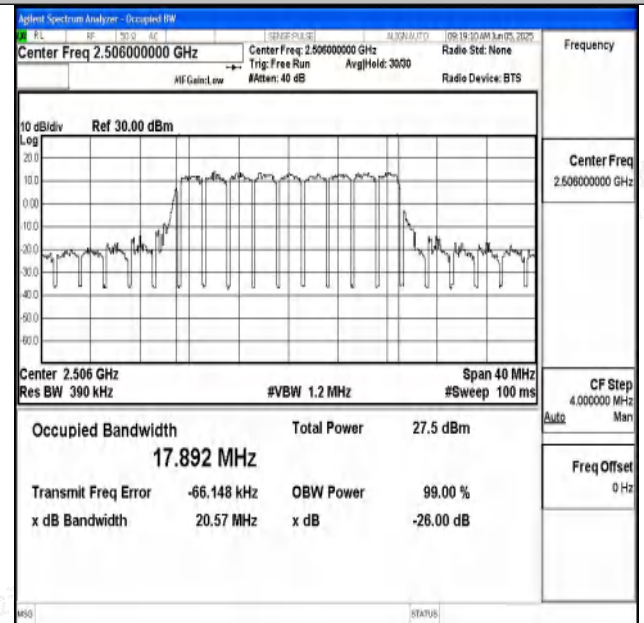

Band41-20MHz-16QAM-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

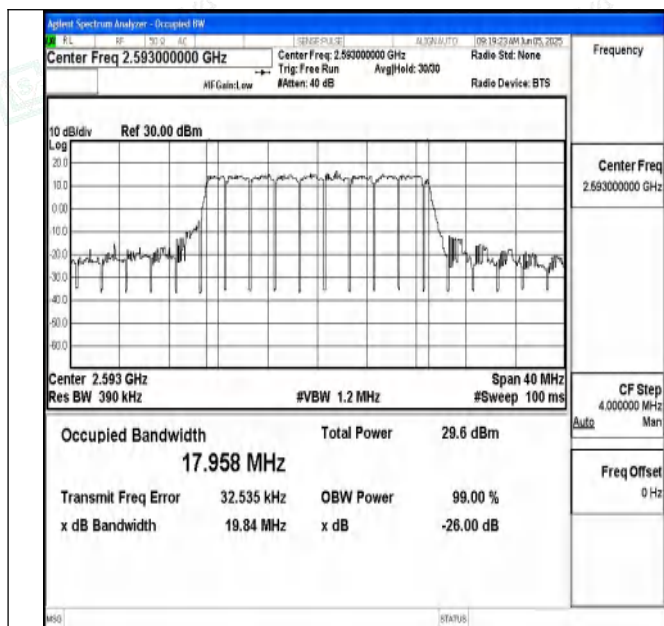


Band41-20MHz-QPSK-40620-100RB#0-PASS

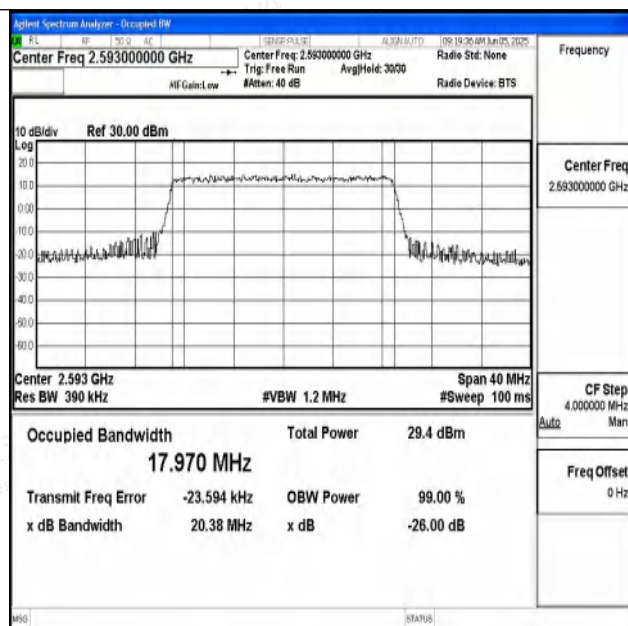

Band41-20MHz-16QAM-40620-100RB#0-PASS

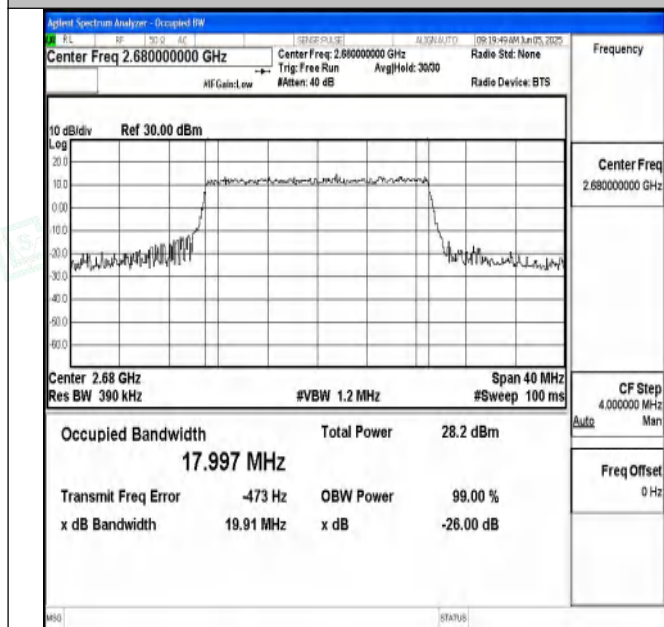

Band41-20MHz-QPSK-41490-100RB#0-PASS

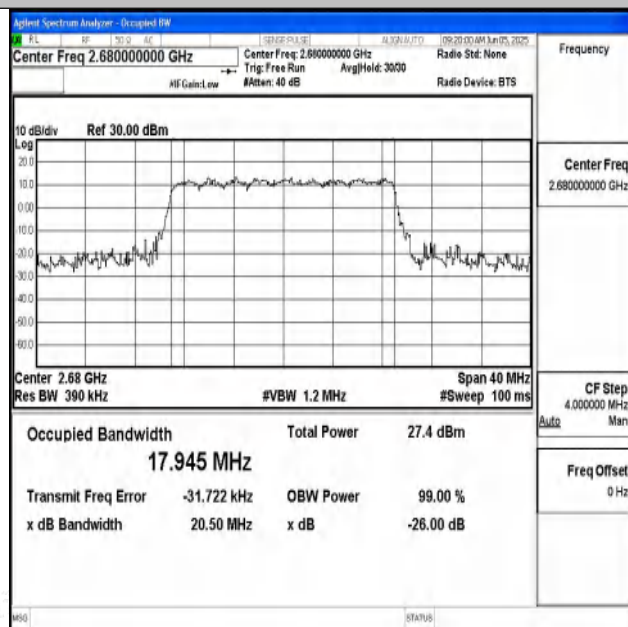

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Q.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	-44.97	PASS
Band41	5MHz	16QAM	39675	25RB#0	-44.21	PASS
Band41	5MHz	QPSK	41565	25RB#0	-40.56	PASS
Band41	5MHz	16QAM	41565	25RB#0	-40.05	PASS
Band41	10MHz	QPSK	39700	50RB#0	-38.73	PASS
Band41	10MHz	16QAM	39700	50RB#0	-39.40	PASS
Band41	10MHz	QPSK	41540	50RB#0	-36.75	PASS
Band41	10MHz	16QAM	41540	50RB#0	-37.01	PASS
Band41	15MHz	QPSK	39725	75RB#0	-35.27	PASS
Band41	15MHz	16QAM	39725	75RB#0	-35.98	PASS
Band41	15MHz	QPSK	41515	75RB#0	-35.94	PASS
Band41	15MHz	16QAM	41515	75RB#0	-35.22	PASS
Band41	20MHz	QPSK	39750	100RB#0	-36.09	PASS
Band41	20MHz	16QAM	39750	100RB#0	-35.30	PASS
Band41	20MHz	QPSK	41490	100RB#0	-34.45	PASS
Band41	20MHz	16QAM	41490	100RB#0	-34.64	PASS

Test Graphs

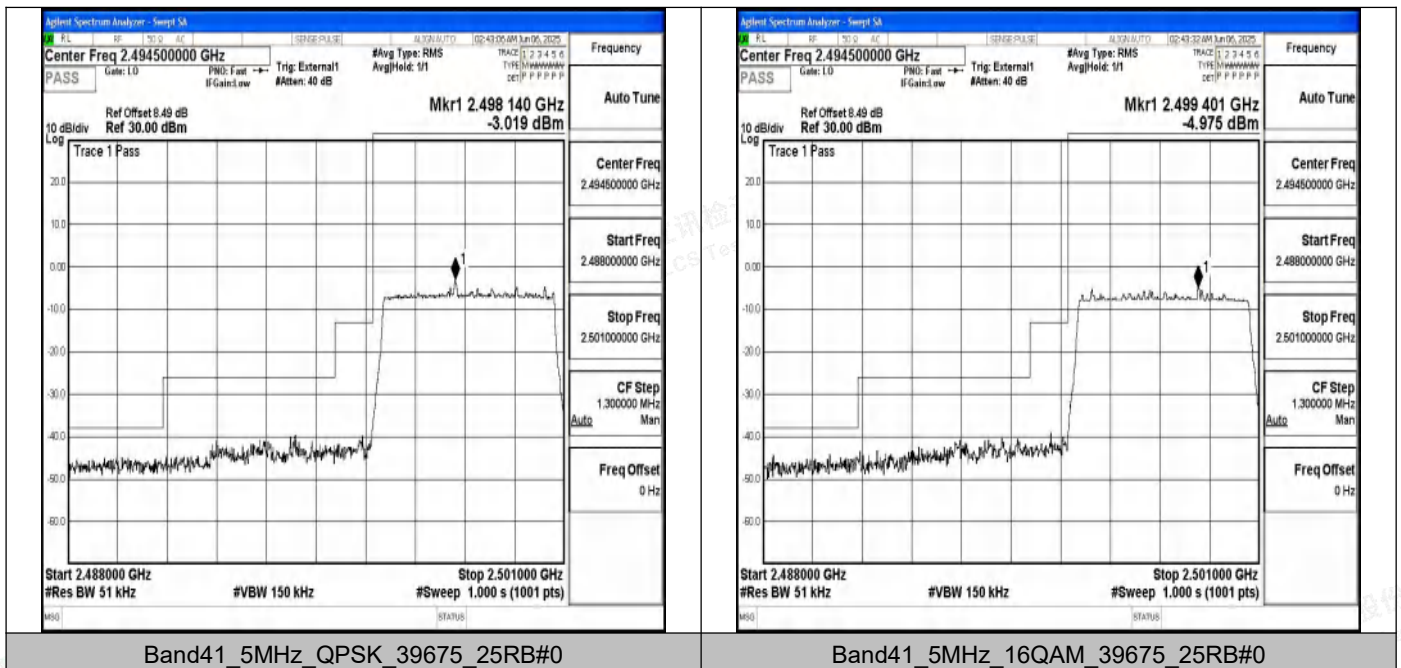


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

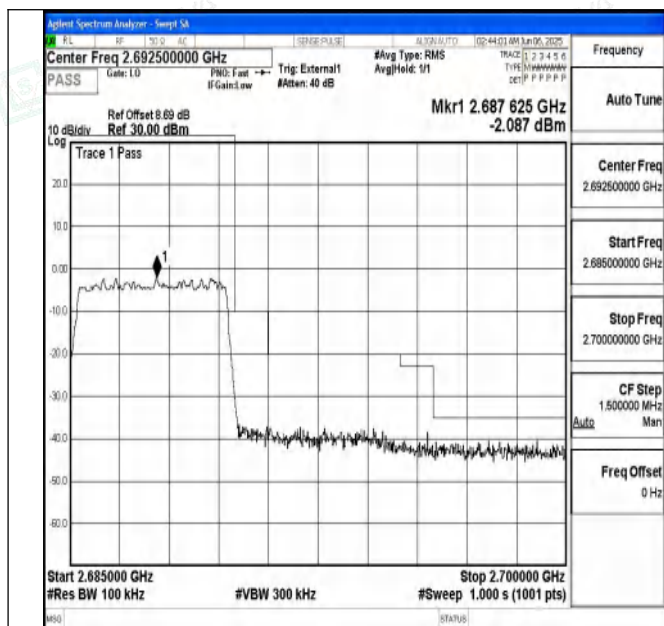


Band41_5MHz_QPSK_41565_25RB#0

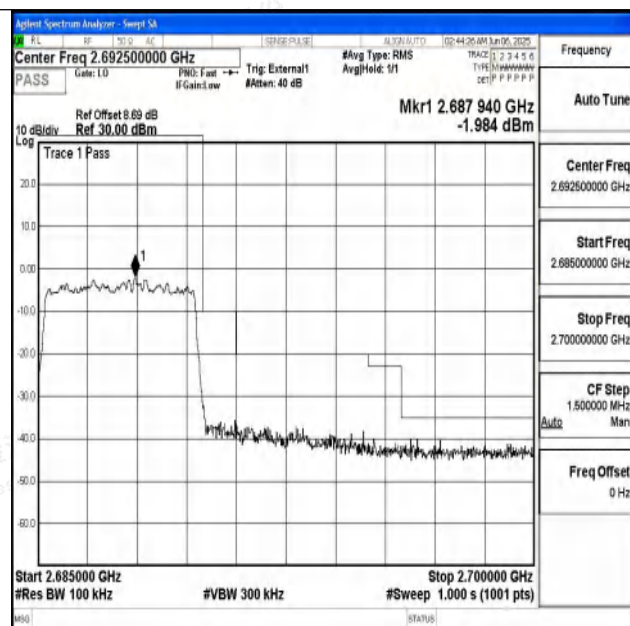

Band41_5MHz_16QAM_41565_25RB#0

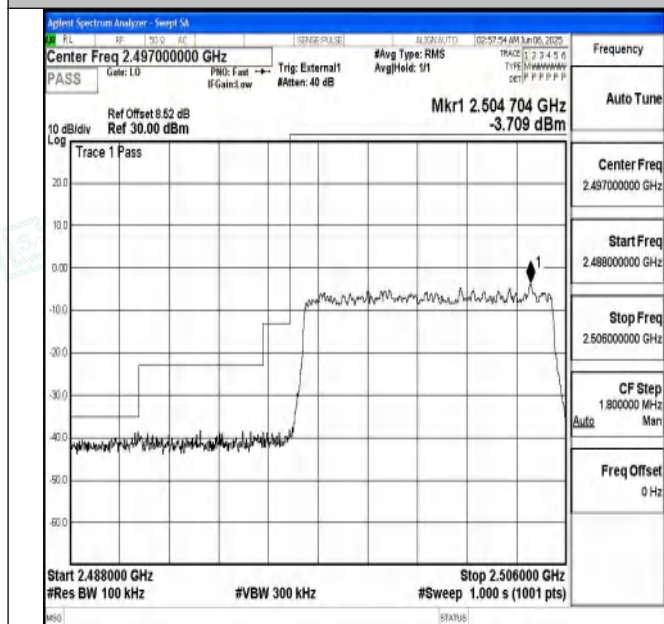

Band41_10MHz_QPSK_39700_50RB#0

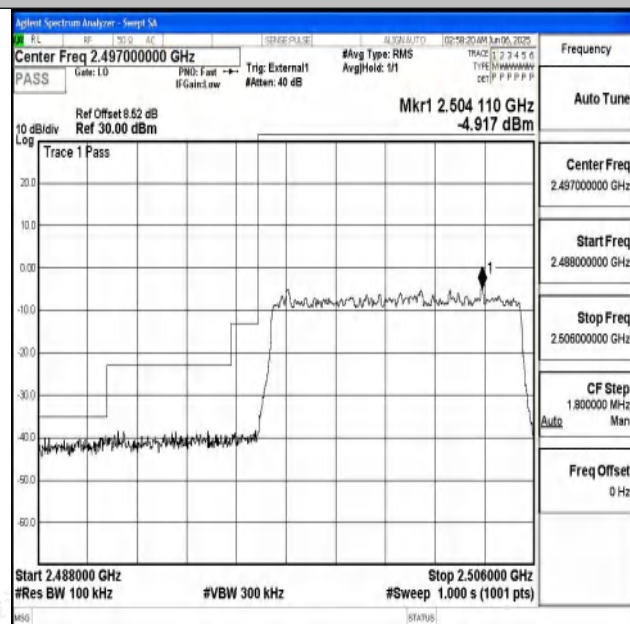

Band41_10MHz_16QAM_39700_50RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

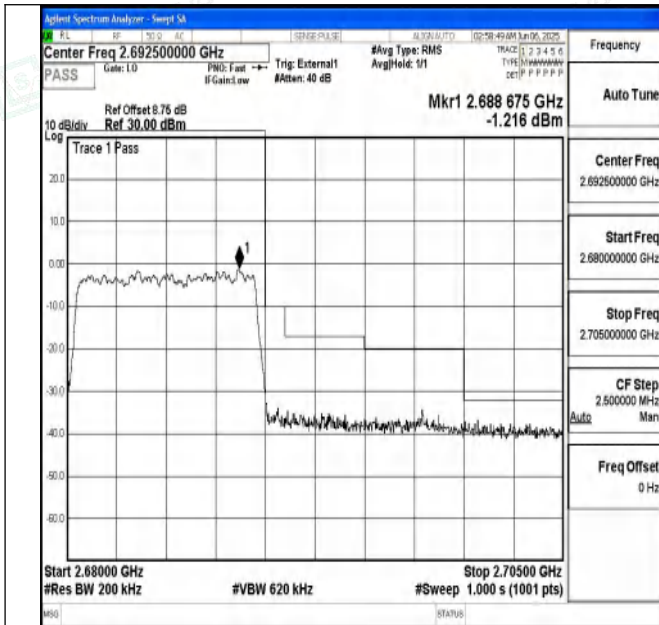


Band41_10MHz_QPSK_41540_50RB#0

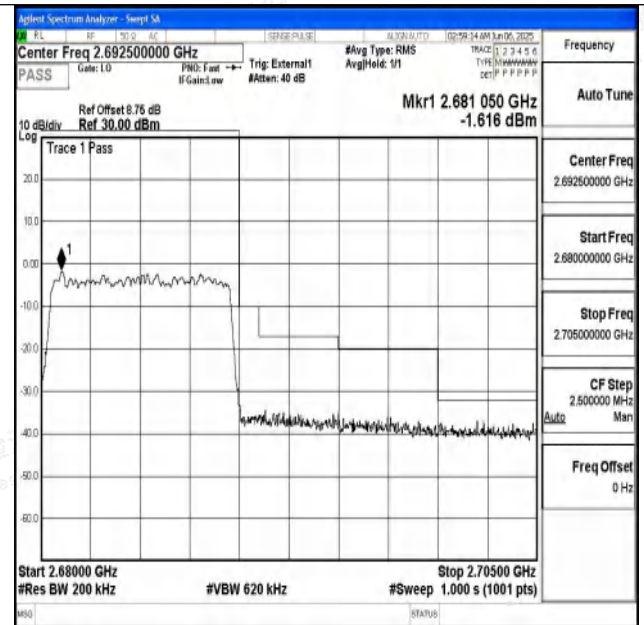

Band41_10MHz_16QAM_41540_50RB#0

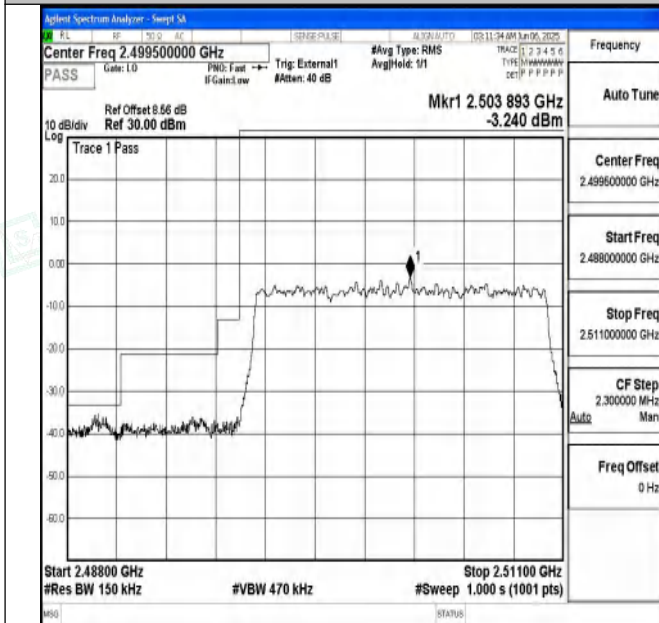

Band41_15MHz_QPSK_39725_75RB#0

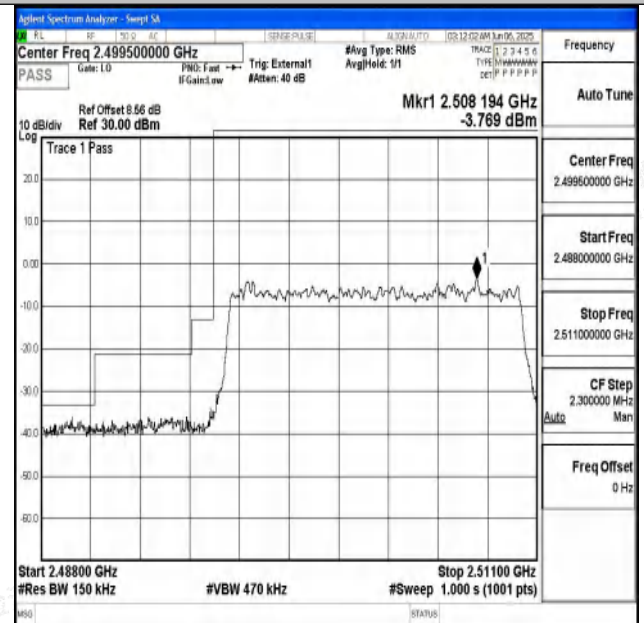

Band41_15MHz_16QAM_39725_75RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

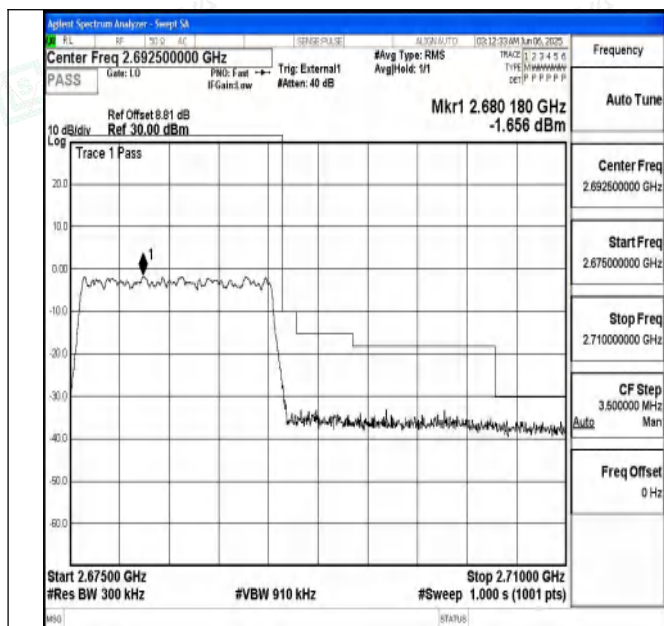


Band41_15MHz_QPSK_41515_75RB#0

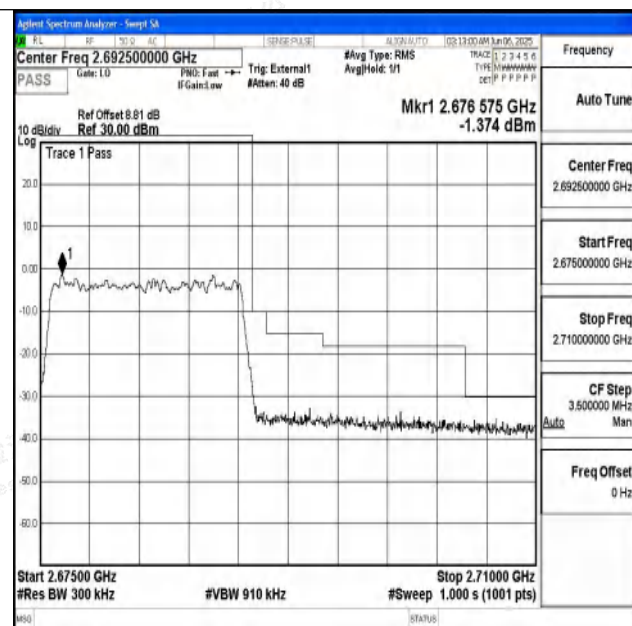

Band41_15MHz_16QAM_41515_75RB#0

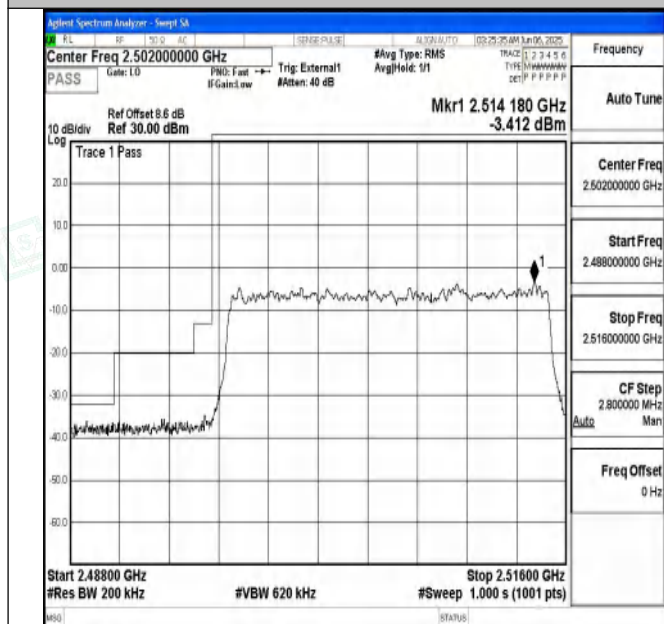

Band41_20MHz_QPSK_39750_100RB#0

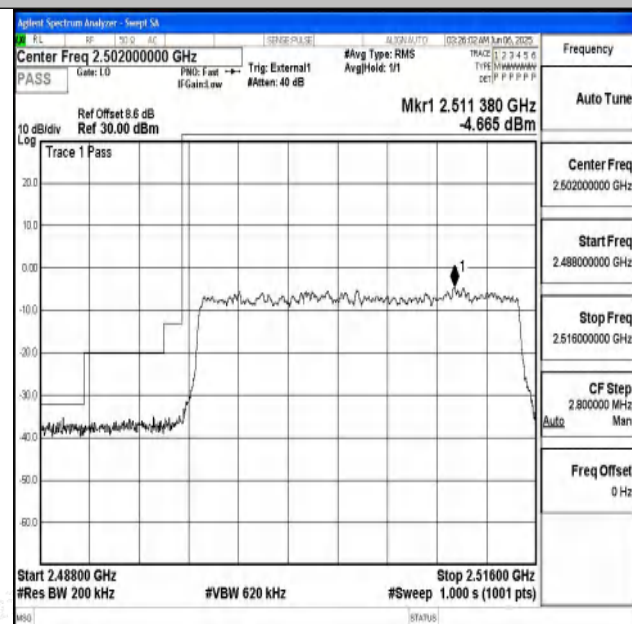

Band41_20MHz_16QAM_39750_100RB#0




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

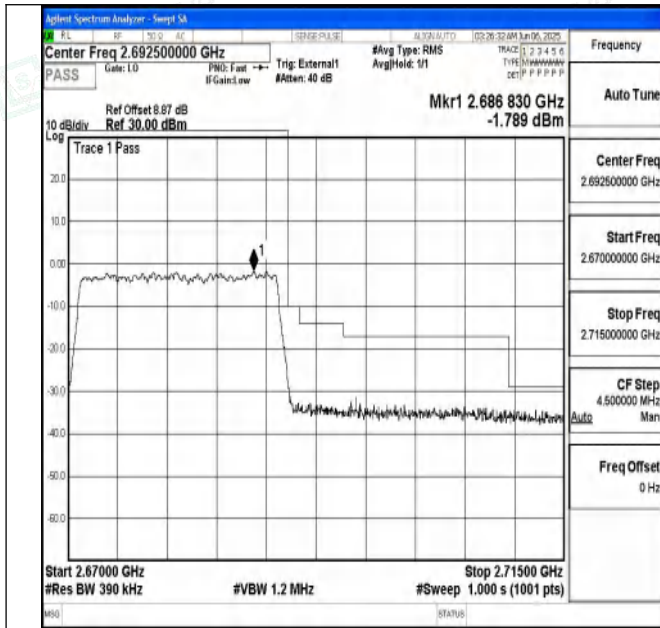

Band41_20MHz_QPSK_41490_100RB#0

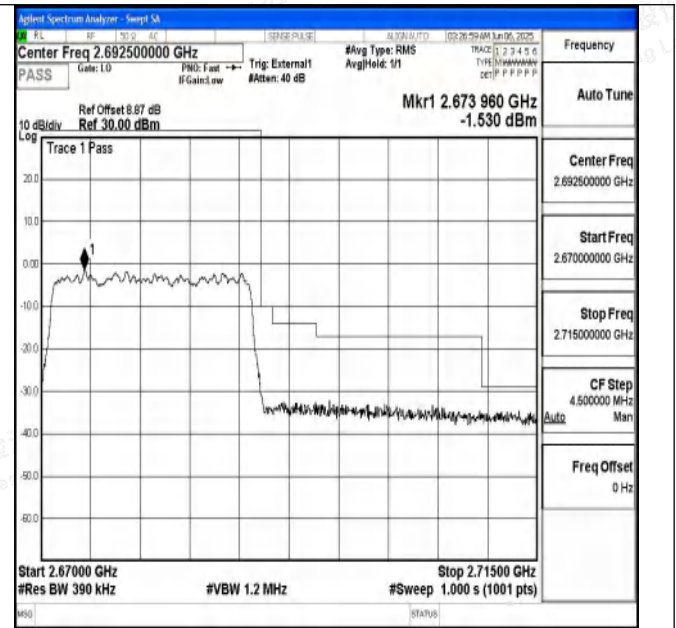

Band41_20MHz_16QAM_41490_100RB#0



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Q.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-65.35	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-63.57	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-71.68	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-44.89	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-36.62	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.63	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-65.24	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-72.84	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-44.70	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.94	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-67.03	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-62.67	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-69.07	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-45.15	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-35.75	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-64.70	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-63.52	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-69.79	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-44.08	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.56	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-64.92	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-64.81	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-72.01	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-44.89	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-36.76	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-64.05	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-67.44	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-72.14	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-44.40	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-36.44	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-64.06	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-61.92	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-73.11	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-43.83	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-36.39	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-64.79	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-63.92	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-72.75	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-44.58	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-36.75	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-64.82	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-64.71	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-73.13	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-44.58	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-36.52	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-62.82	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-62.45	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-72.65	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-44.29	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.68	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-66.96	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-65.62	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-72.38	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-44.53	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.84	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-66.20	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-62.85	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-71.00	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-44.57	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-36.10	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-66.22	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-66.45	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-72.73	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-44.42	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-35.38	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-65.64	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-65.61	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-72.90	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-44.59	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-36.48	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-66.05	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-66.57	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-72.14	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-44.49	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-36.35	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-66.20	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-66.33	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-72.14	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-44.59	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.91	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-65.32	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-64.20	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-72.50	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-44.17	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-36.05	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-65.87	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-65.02	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-72.98	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-44.41	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.59	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-65.35	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-60.00	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-72.97	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-42.64	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.56	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-65.66	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-63.17	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-72.82	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-44.46	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-36.39	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-65.93	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-66.06	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-73.13	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-44.58	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-35.12	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-65.24	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-63.16	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-73.41	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-44.06	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-35.31	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-64.77	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-64.39	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-73.15	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-44.64	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-36.16	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-66.88	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-63.14	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-72.74	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-45.06	PASS
Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-36.76	PASS

Test Graphs

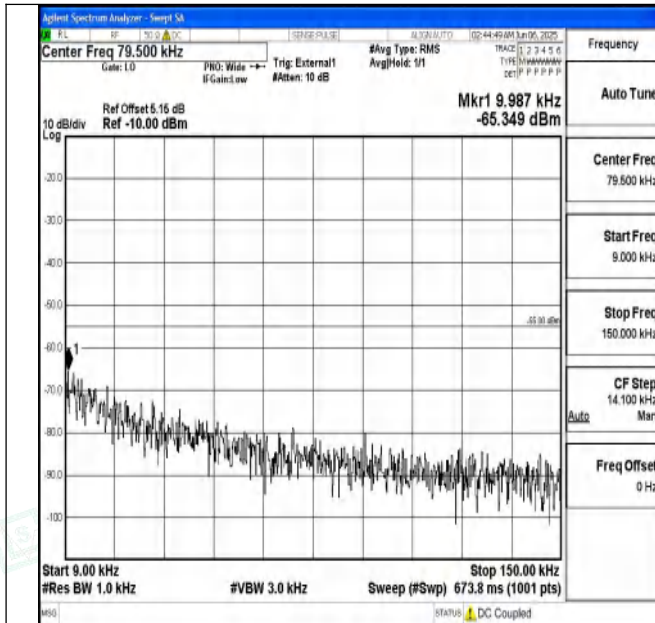


Band41_5MHz_QPSK_39675_1RB#0_0.009~0.15_0.009~0.


15

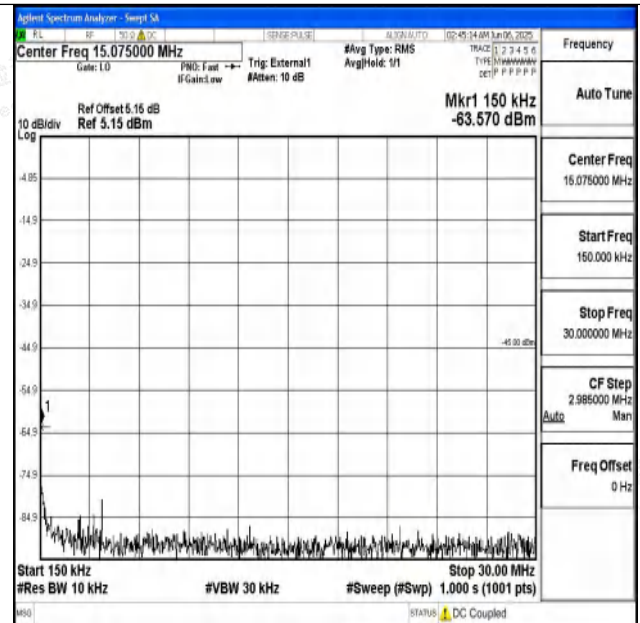

Band41_5MHz_QPSK_39675_1RB#0_0.15~30_0.15~30

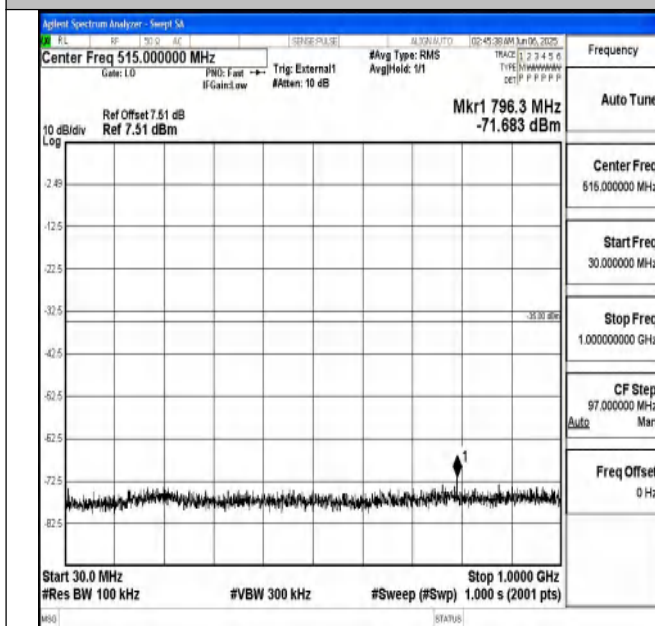

Band41_5MHz_QPSK_39675_1RB#0_30~1000_30~1000

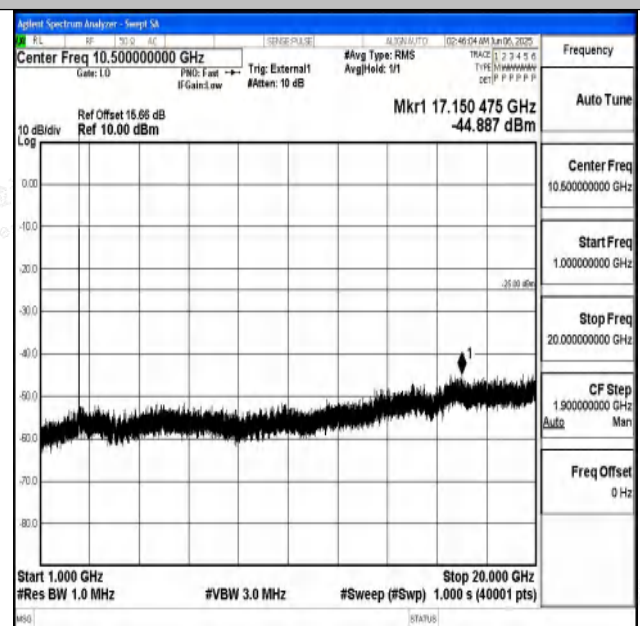

Band41_5MHz_QPSK_39675_1RB#0_1000~20000_1000~20



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




000

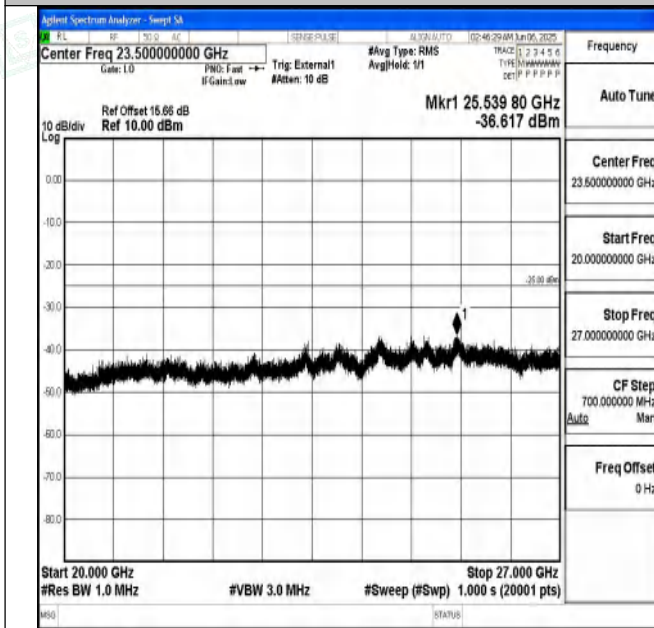


Band41_5MHz_QPSK_39675_1RB#0_20000~27000_20000~27000

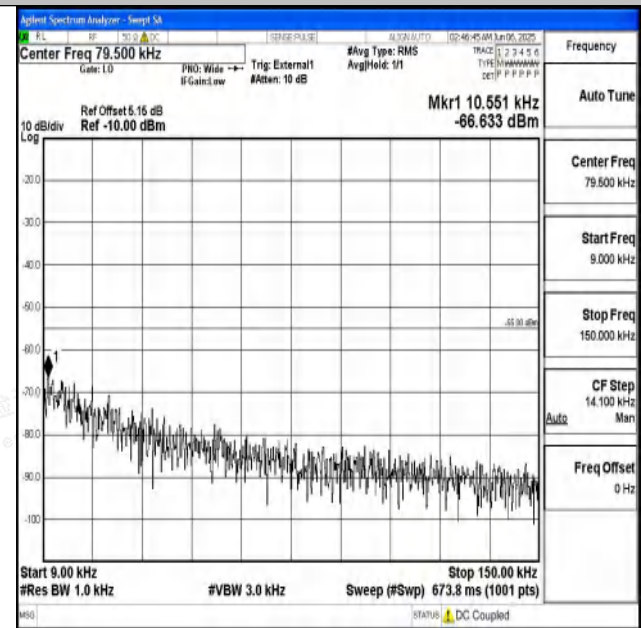

Band41_5MHz_16QAM_39675_1RB#0_0.009~0.15_0.009~0.15

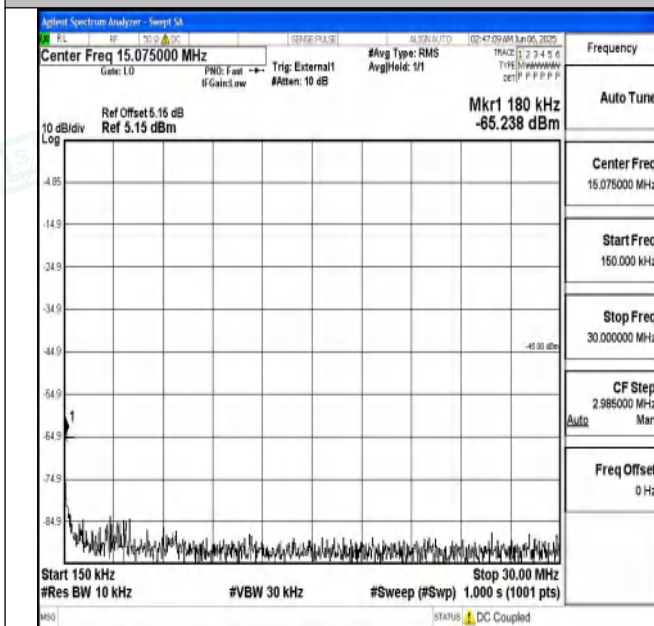

Band41_5MHz_16QAM_39675_1RB#0_0.15~30_0.15~30

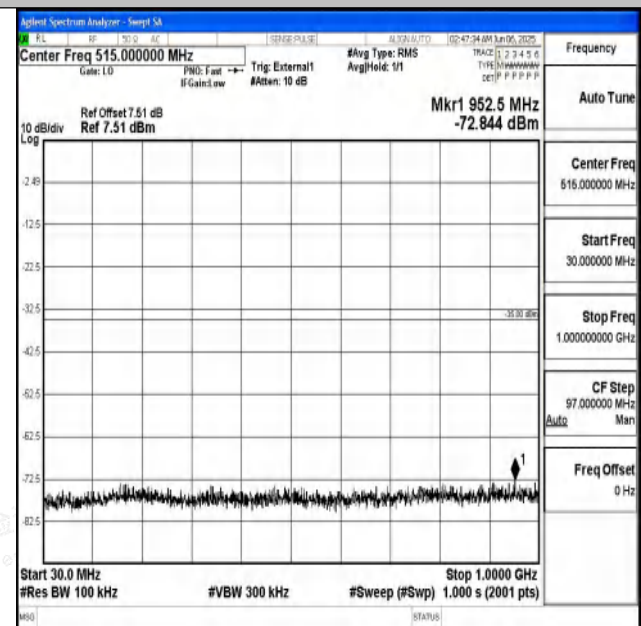

Band41_5MHz_16QAM_39675_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

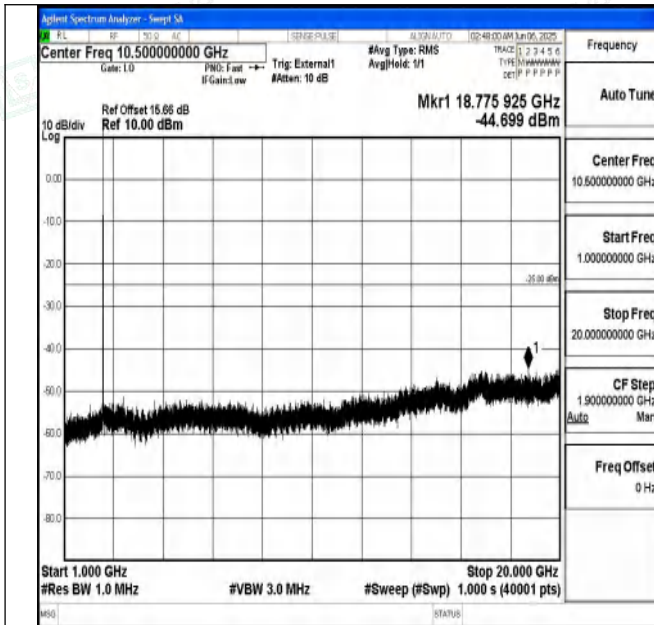


Band41_5MHz_16QAM_39675_1RB#0_1000~20000_1000~
20000

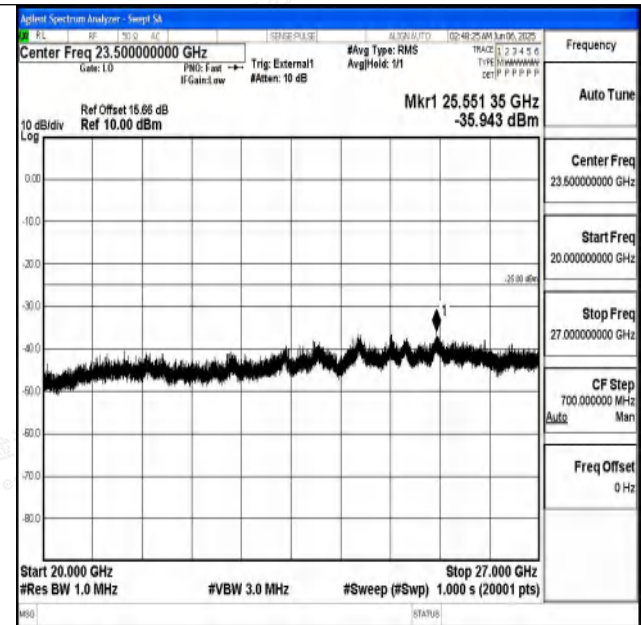

Band41_5MHz_16QAM_39675_1RB#0_20000~27000_20000
~27000

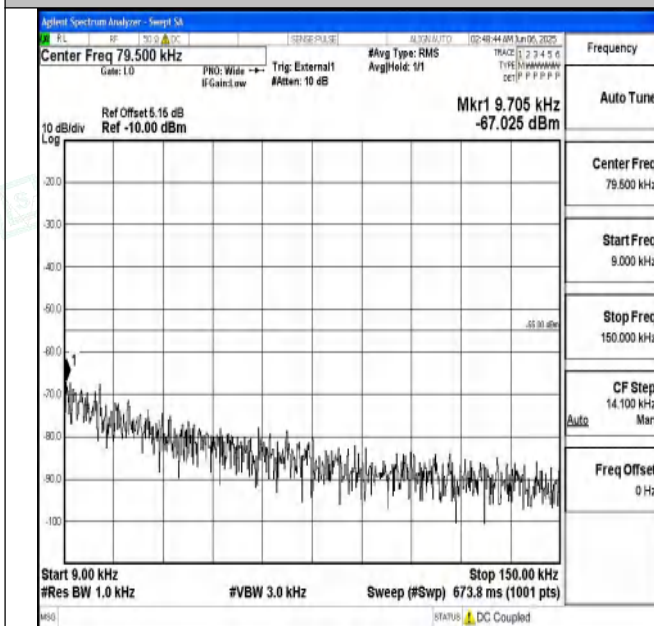

Band41_5MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.
15

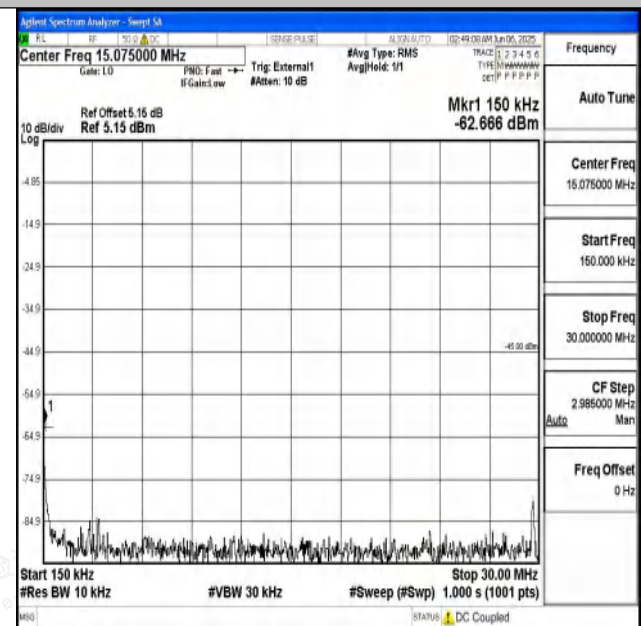

Band41_5MHz_QPSK_40620_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

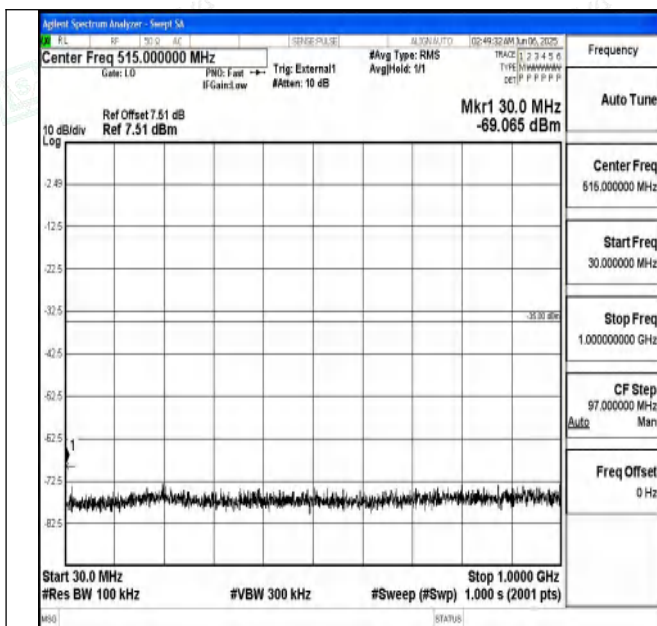


Band41_5MHz_QPSK_40620_1RB#0_30~1000_30~1000

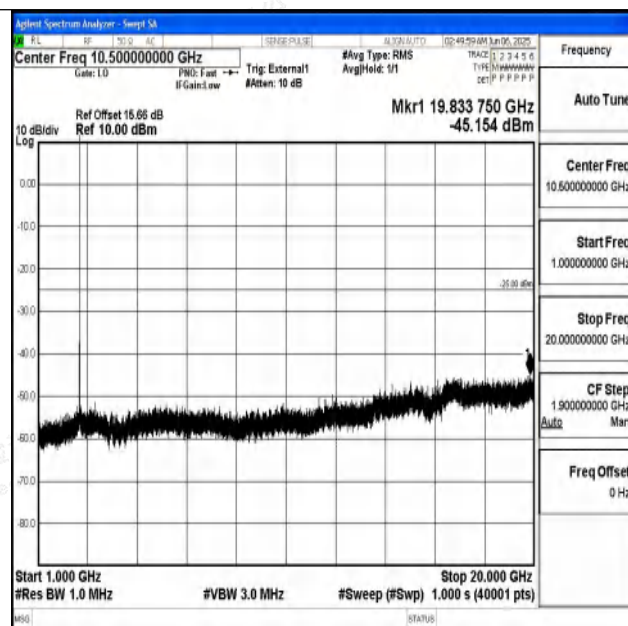

Band41_5MHz_QPSK_40620_1RB#0_1000~20000_1000~20000

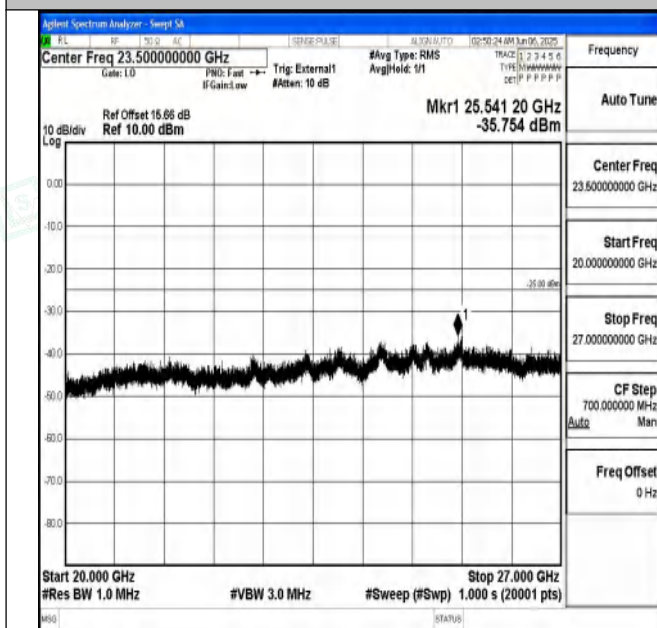

Band41_5MHz_QPSK_40620_1RB#0_20000~27000_20000~27000

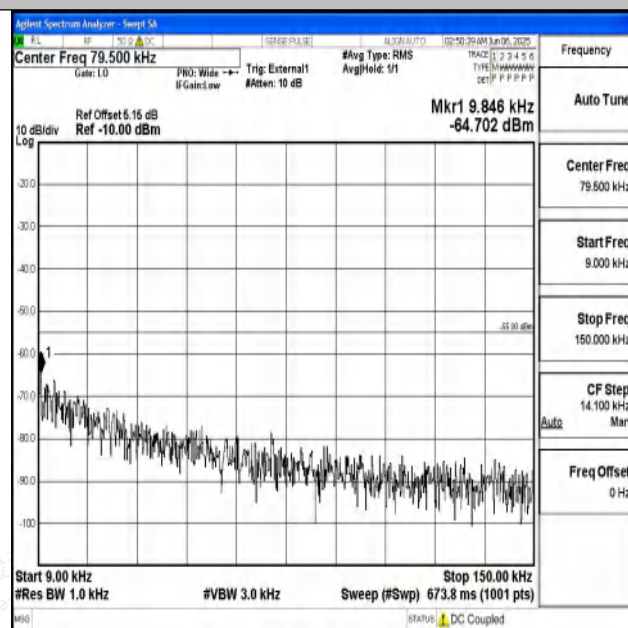

Band41_5MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

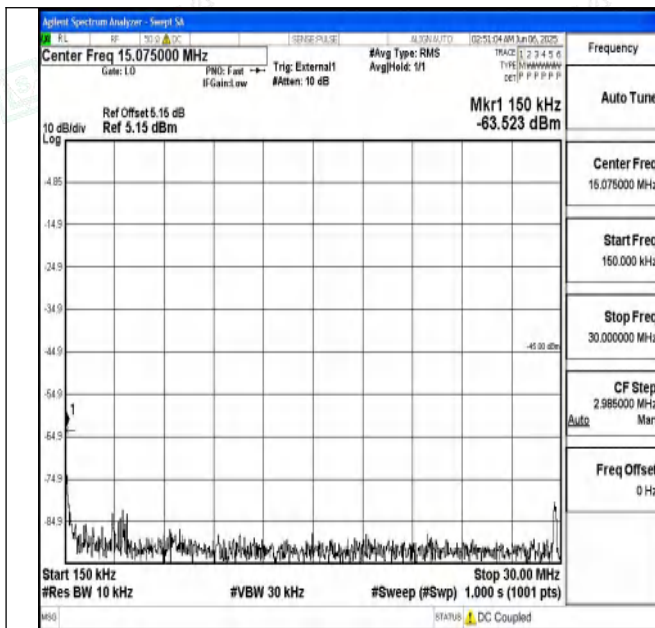


Band41_5MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

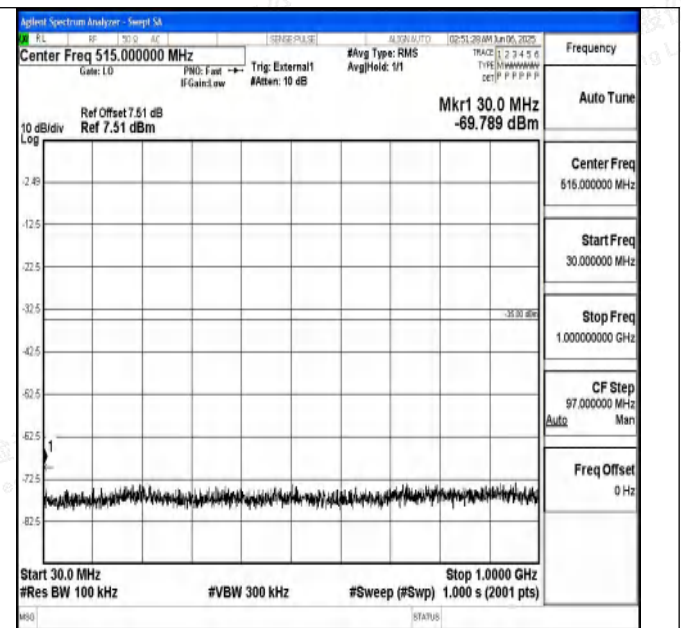

Band41_5MHz_16QAM_40620_1RB#0_30~1000_30~1000

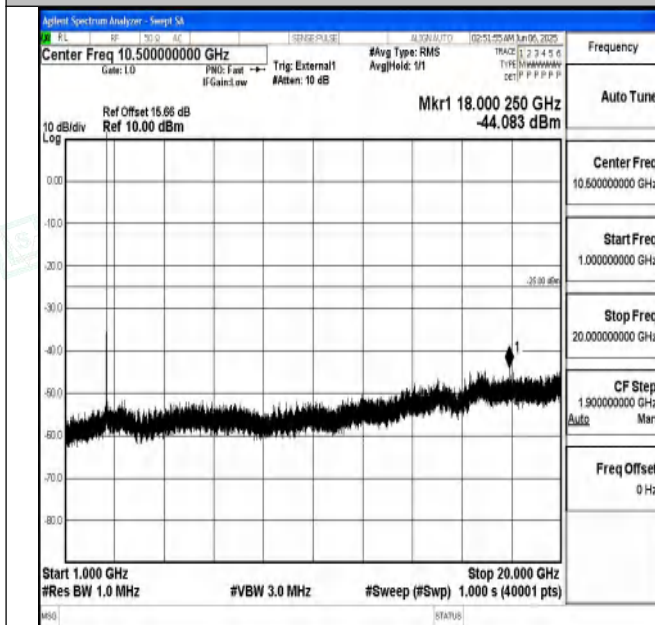

Band41_5MHz_16QAM_40620_1RB#0_1000~20000_1000~20000

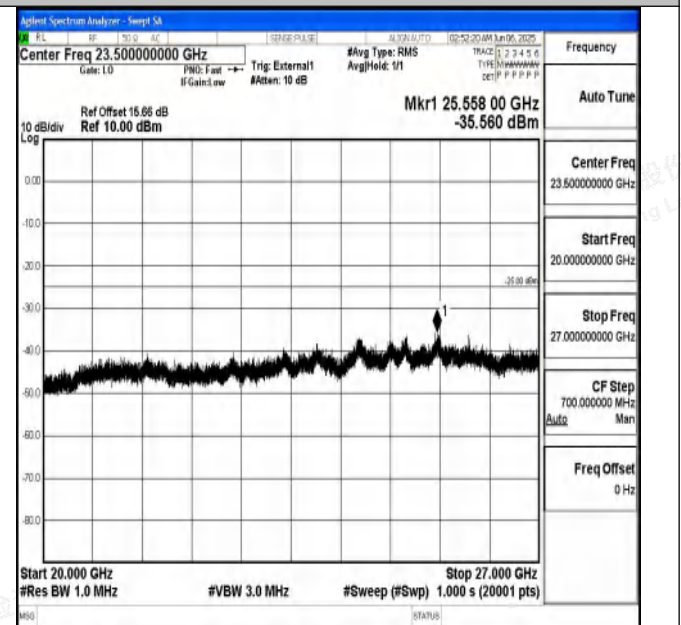

Band41_5MHz_16QAM_40620_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

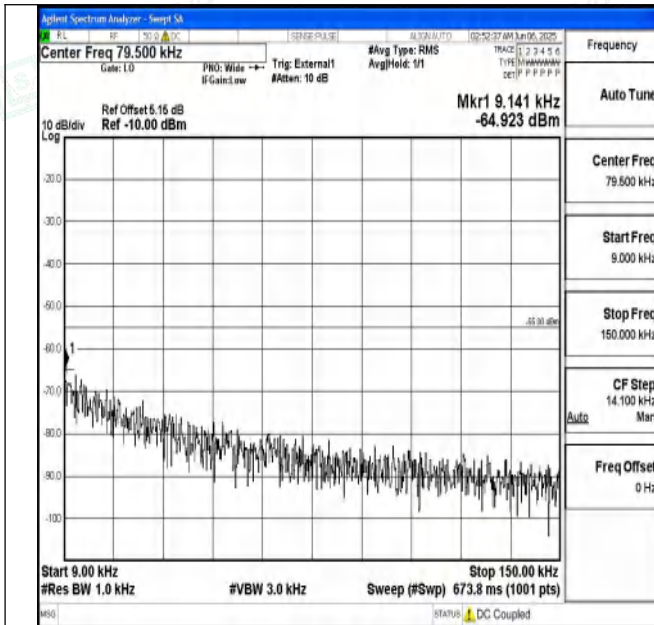


Band41_5MHz_QPSK_41565_1RB#0_0.009~0.15_0.009~0.


15

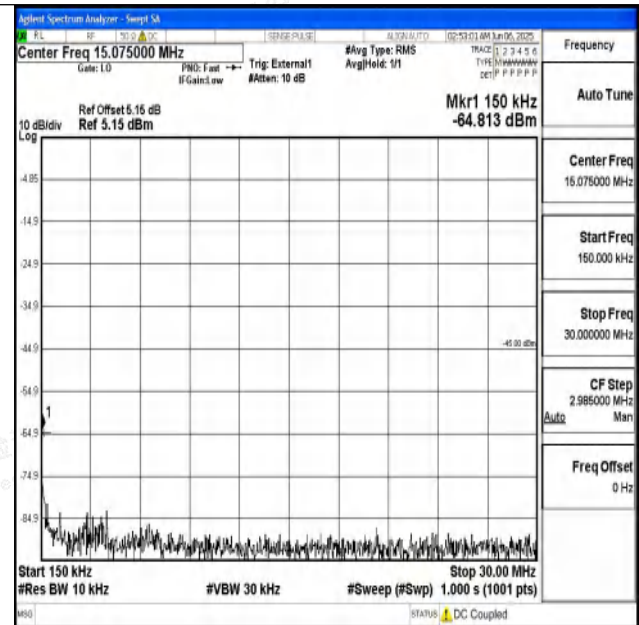

Band41_5MHz_QPSK_41565_1RB#0_0.15~30_0.15~30

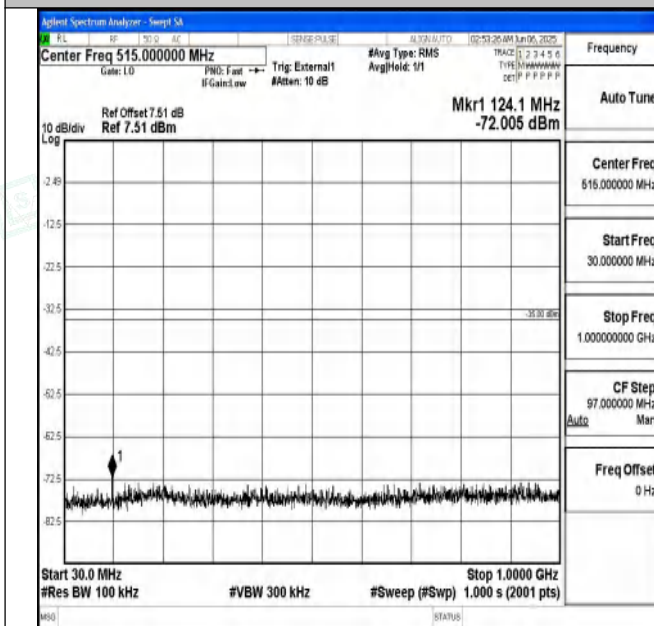

Band41_5MHz_QPSK_41565_1RB#0_30~1000_30~1000

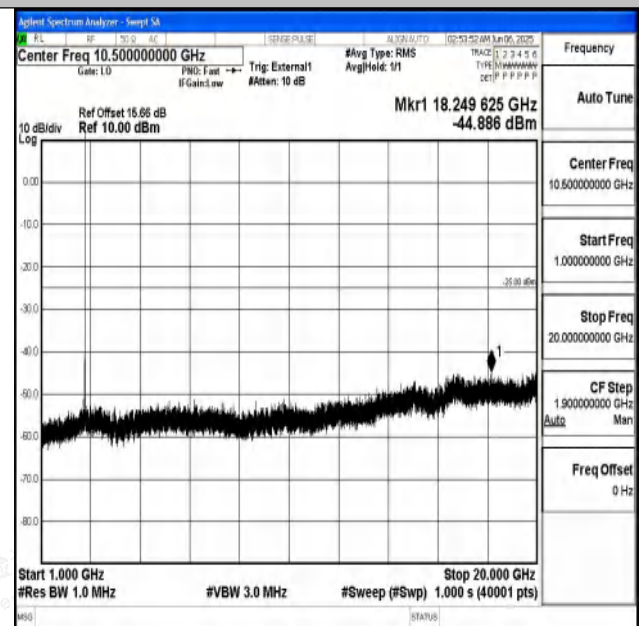

Band41_5MHz_QPSK_41565_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

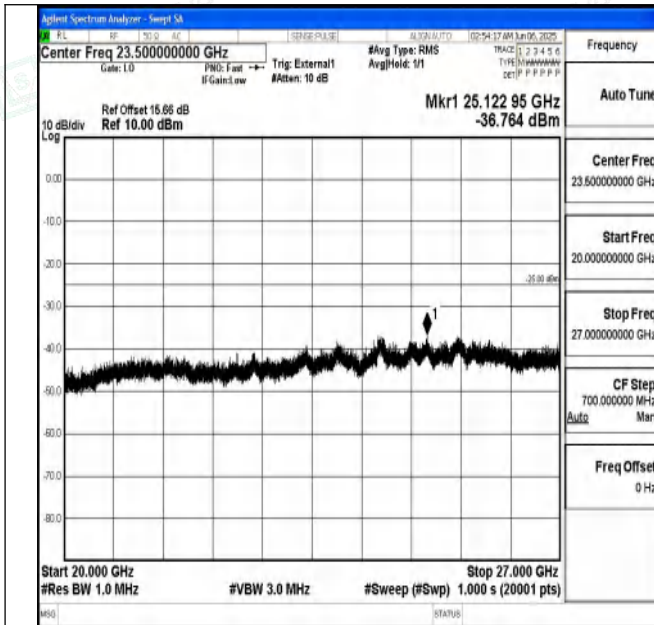


Band41_5MHz_QPSK_41565_1RB#0_20000~27000_20000
~27000

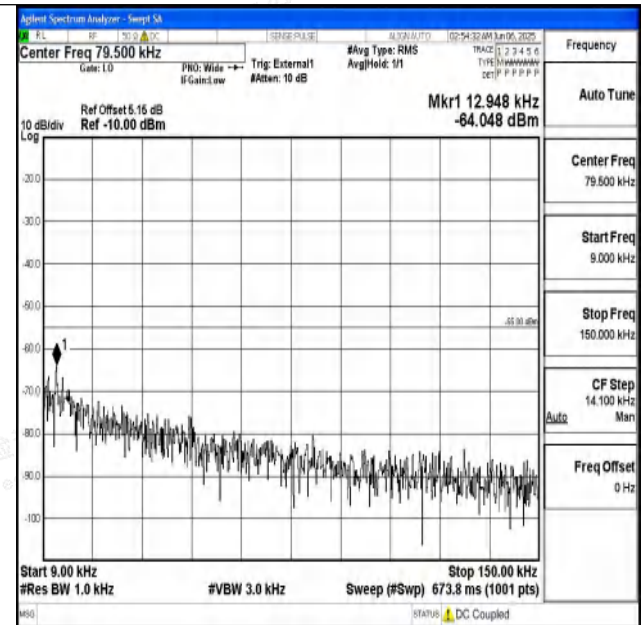

Band41_5MHz_16QAM_41565_1RB#0_0.009~0.15_0.009~0.
15

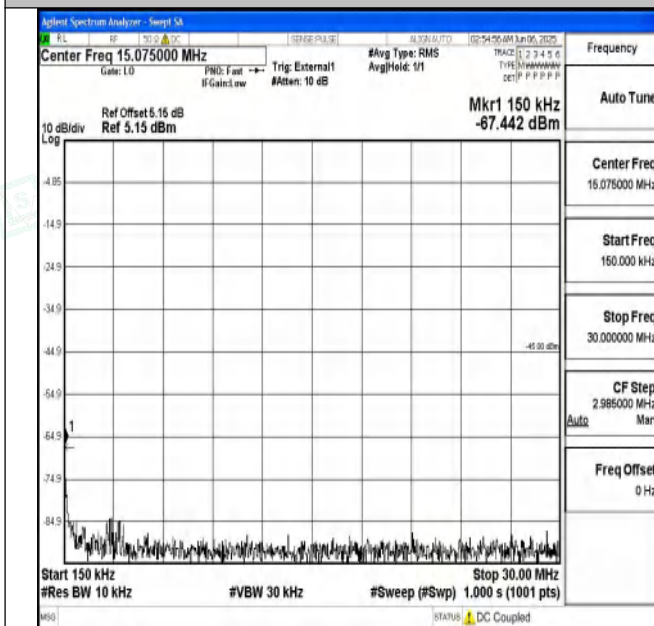

Band41_5MHz_16QAM_41565_1RB#0_0.15~30_0.15~30

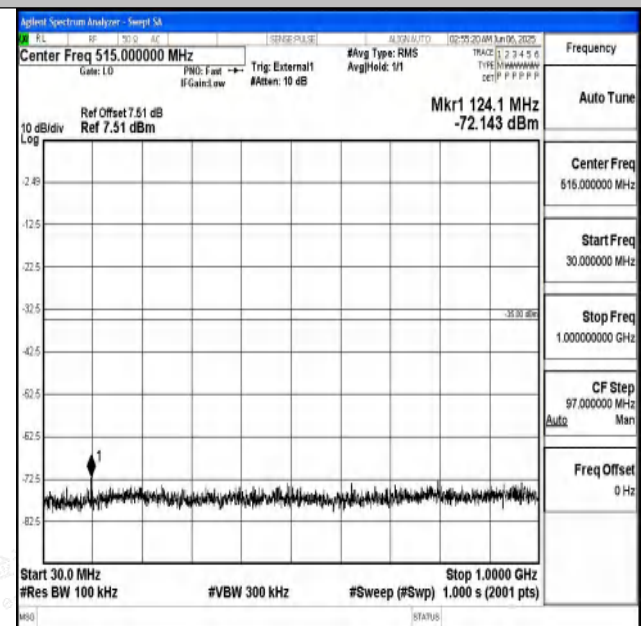

Band41_5MHz_16QAM_41565_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

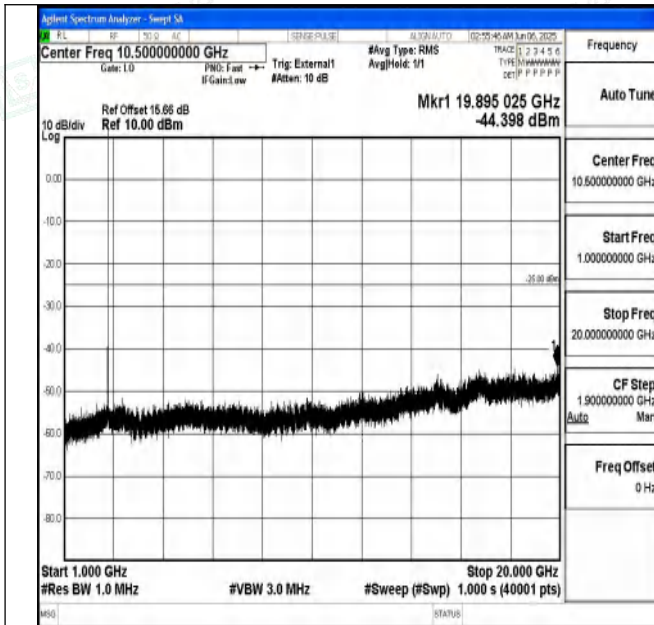


Band41_5MHz_16QAM_41565_1RB#0_1000~20000_1000~20000

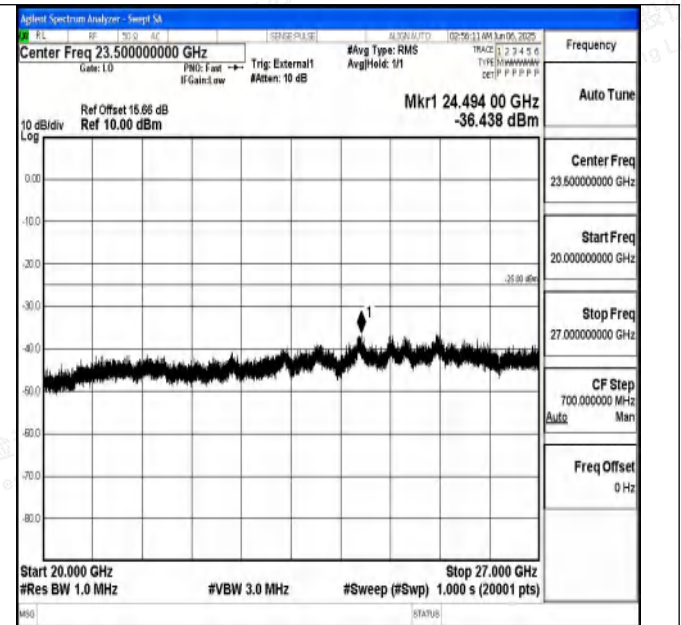

Band41_5MHz_16QAM_41565_1RB#0_20000~27000_20000~27000

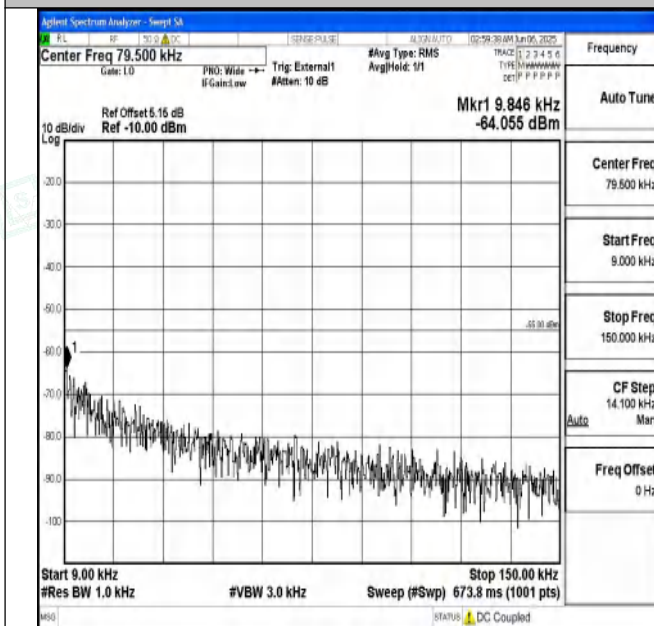

Band41_10MHz_QPSK_39700_1RB#0_0.009~0.15_0.009~0.15

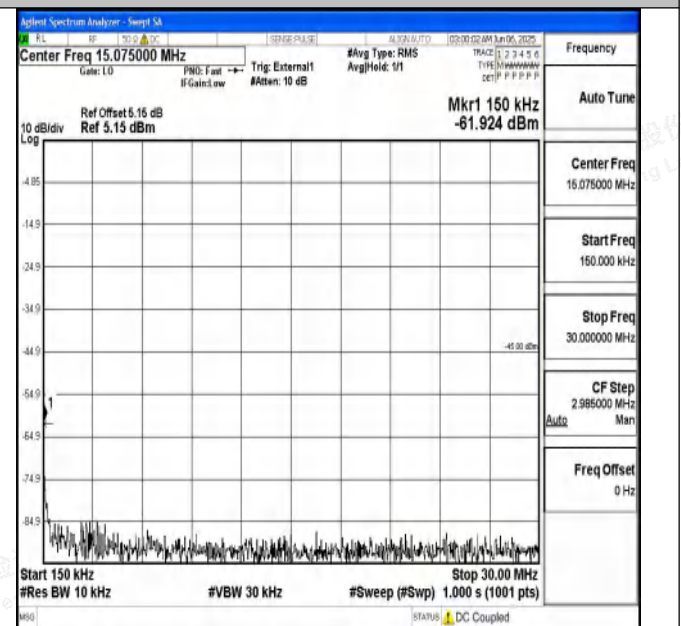

Band41_10MHz_QPSK_39700_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

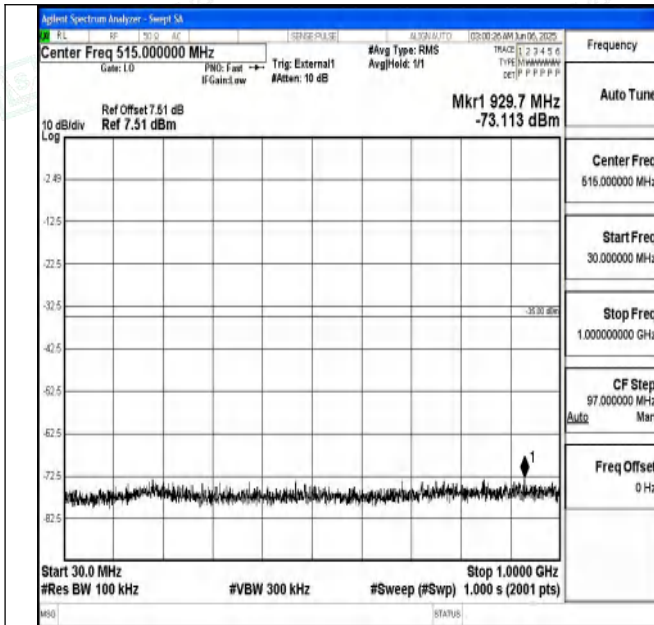


Band41_10MHz_QPSK_39700_1RB#0_30~1000_30~1000

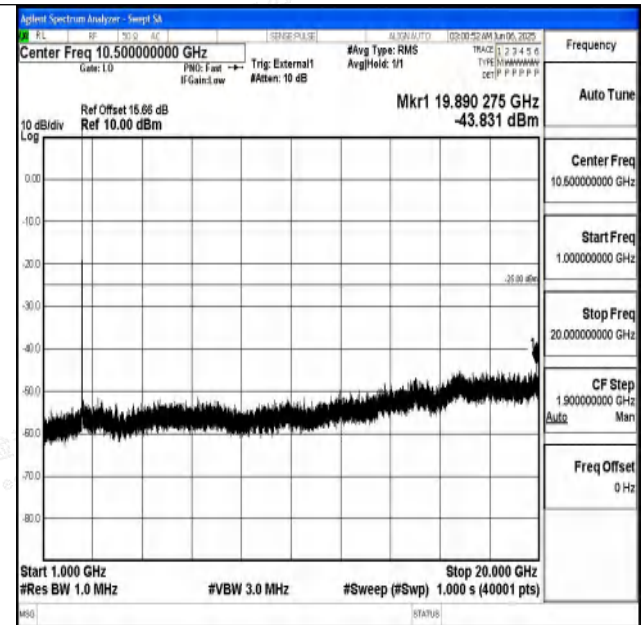

Band41_10MHz_QPSK_39700_1RB#0_1000~20000_1000~20000

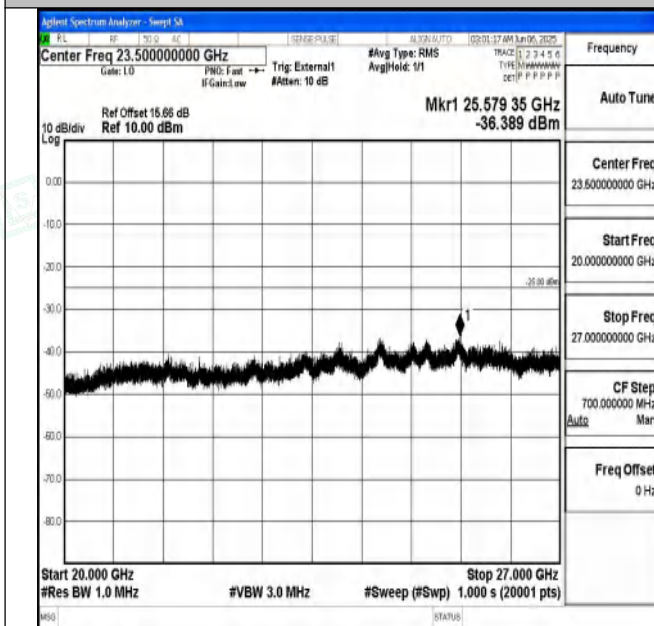

Band41_10MHz_QPSK_39700_1RB#0_20000~27000_20000~27000

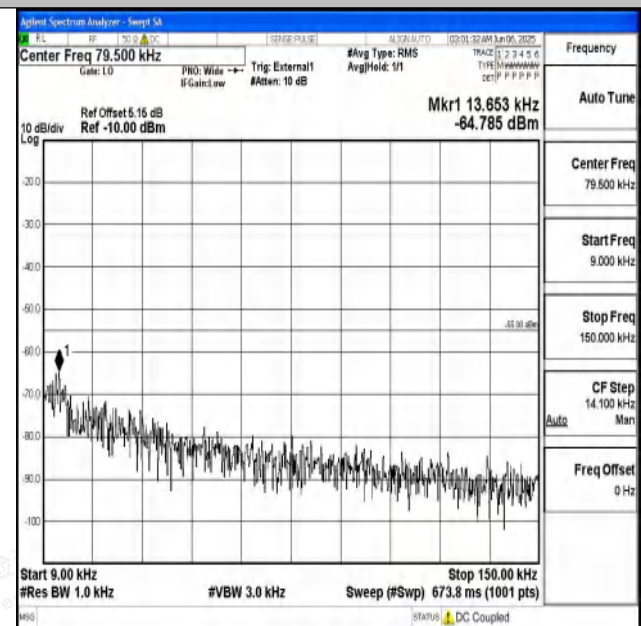

Band41_10MHz_16QAM_39700_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

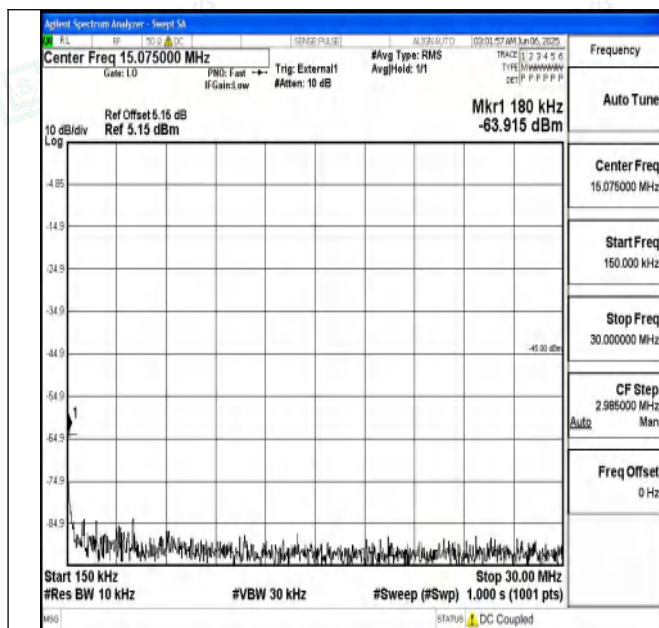


Band41_10MHz_16QAM_39700_1RB#0_0.15~30_0.15~30

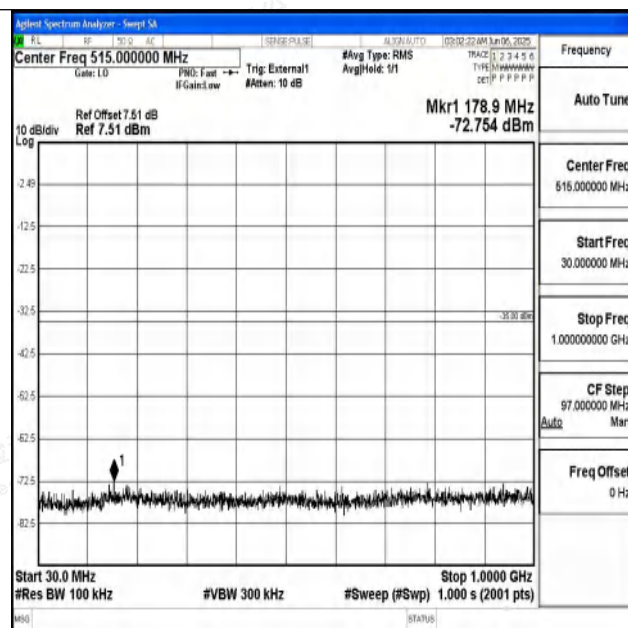

Band41_10MHz_16QAM_39700_1RB#0_30~1000_30~1000

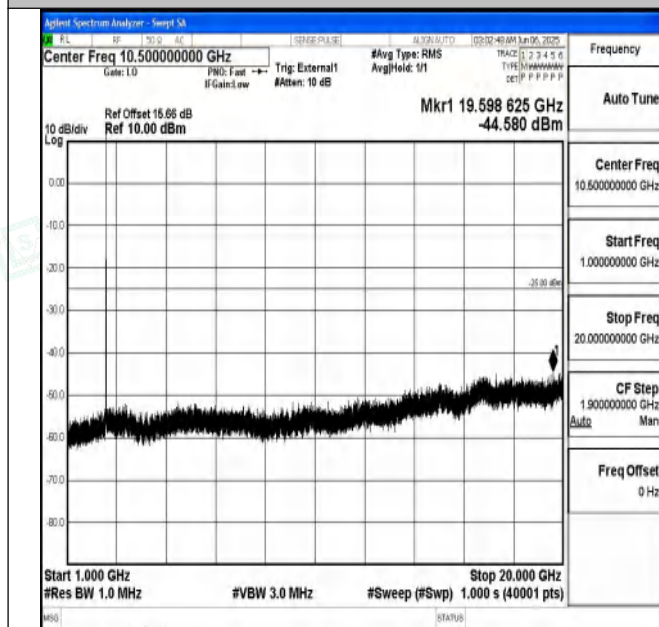

Band41_10MHz_16QAM_39700_1RB#0_1000~20000_1000~20000

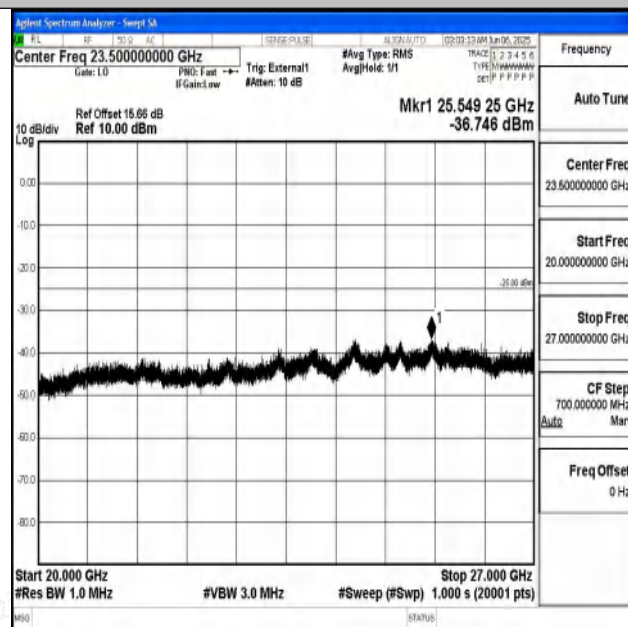

Band41_10MHz_16QAM_39700_1RB#0_20000~27000_20000~27000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

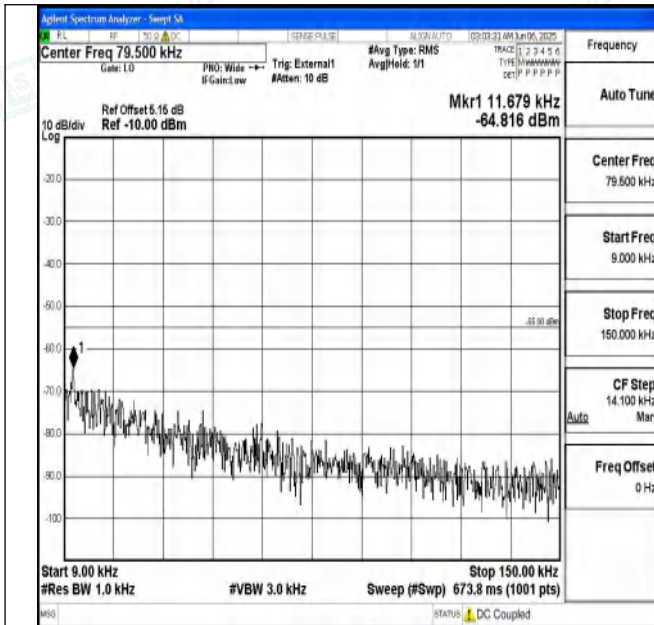


Band41_10MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

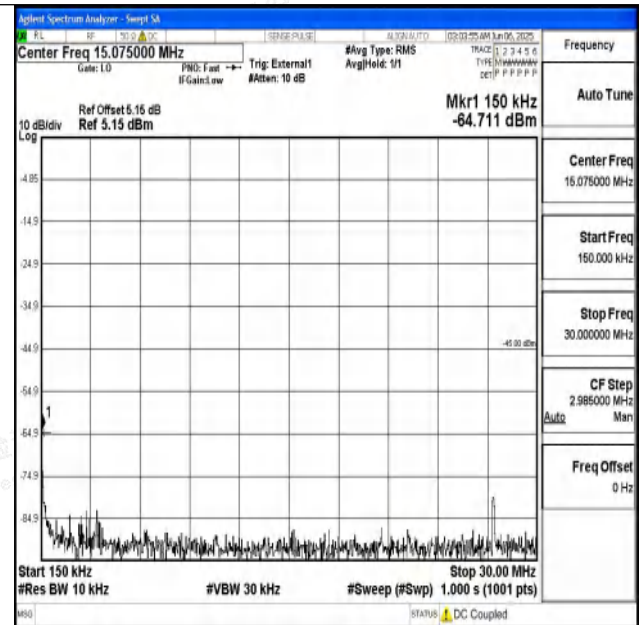

Band41_10MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

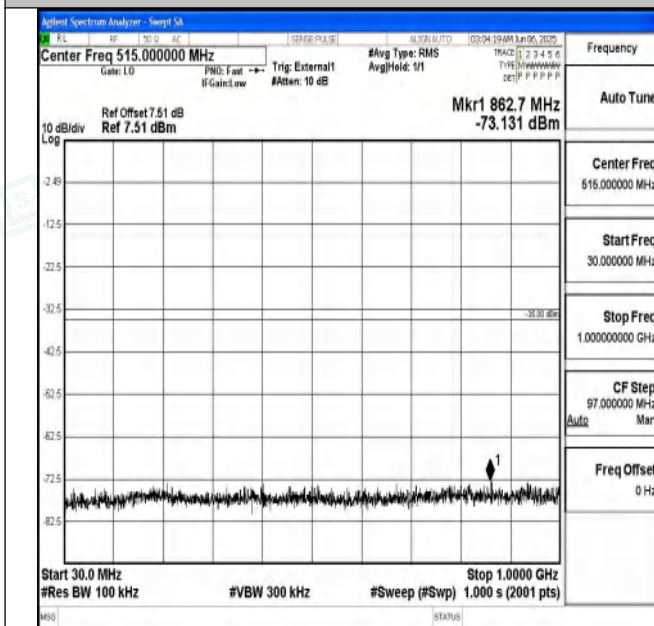

Band41_10MHz_QPSK_40620_1RB#0_30~1000_30~1000

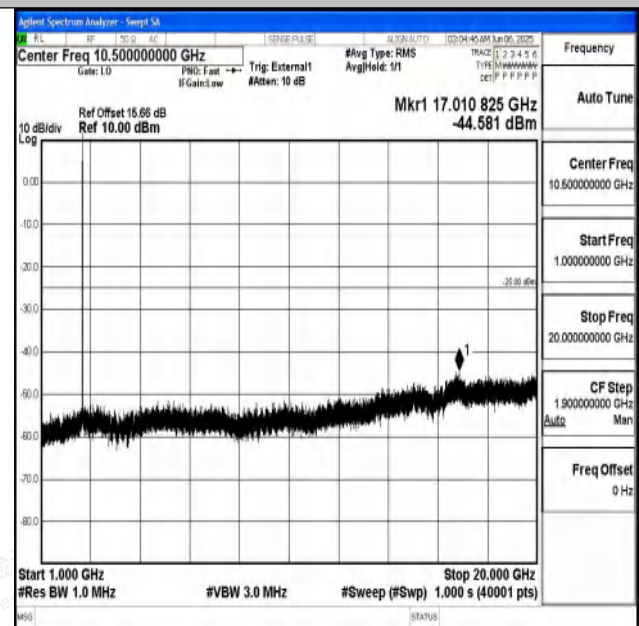

Band41_10MHz_QPSK_40620_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

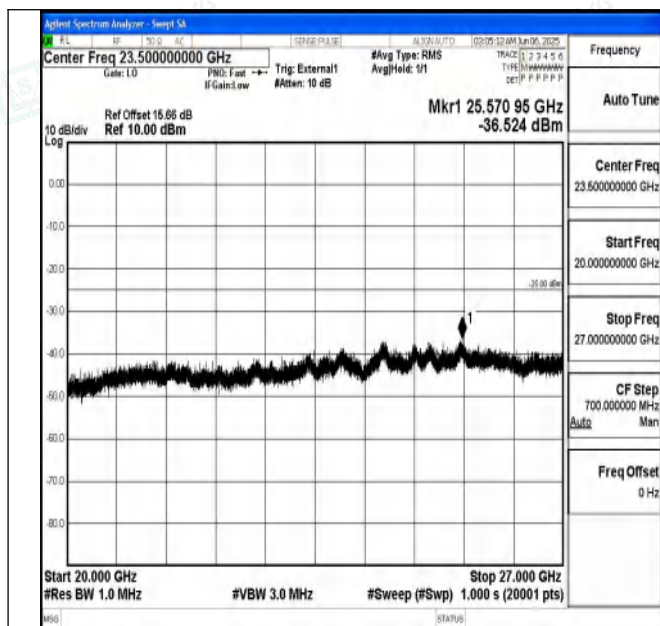


Band41_10MHz_QPSK_40620_1RB#0_20000~27000_2000
0~27000

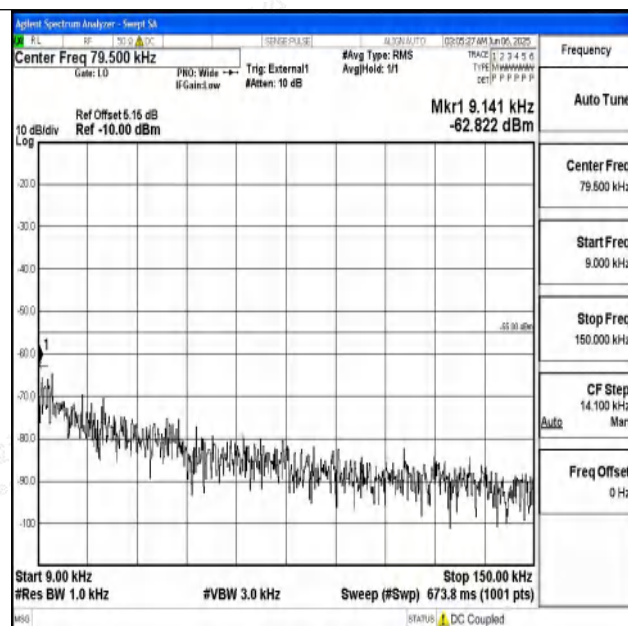

Band41_10MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15

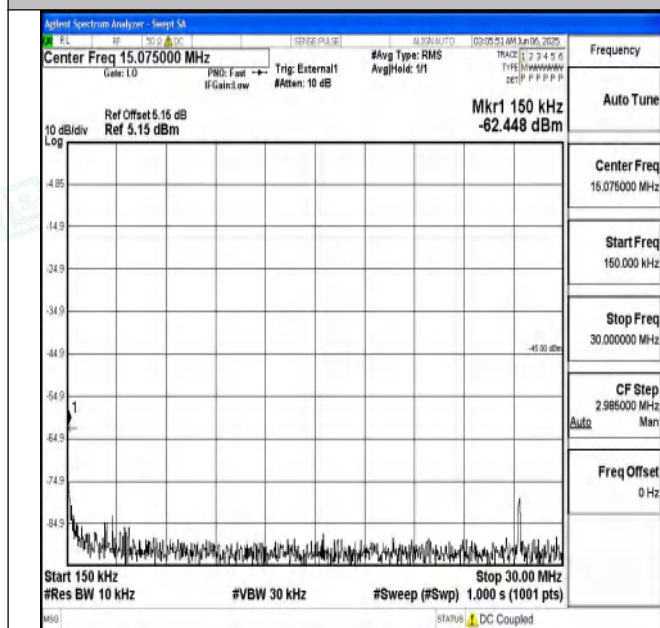

Band41_10MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

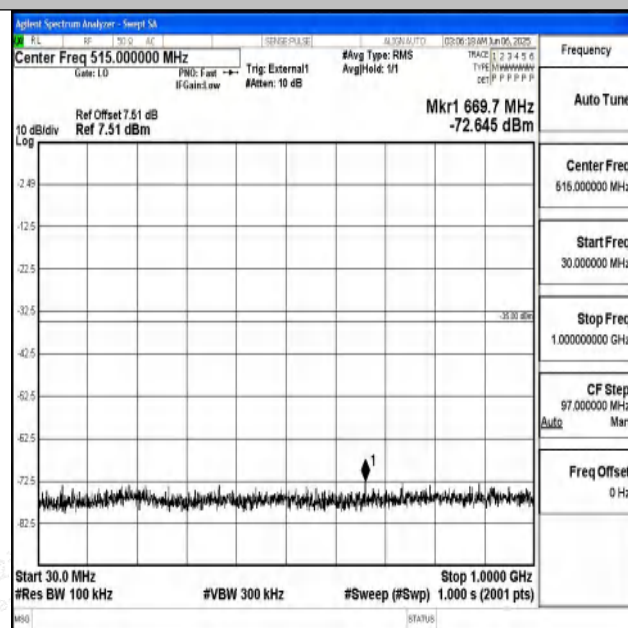

Band41_10MHz_16QAM_40620_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

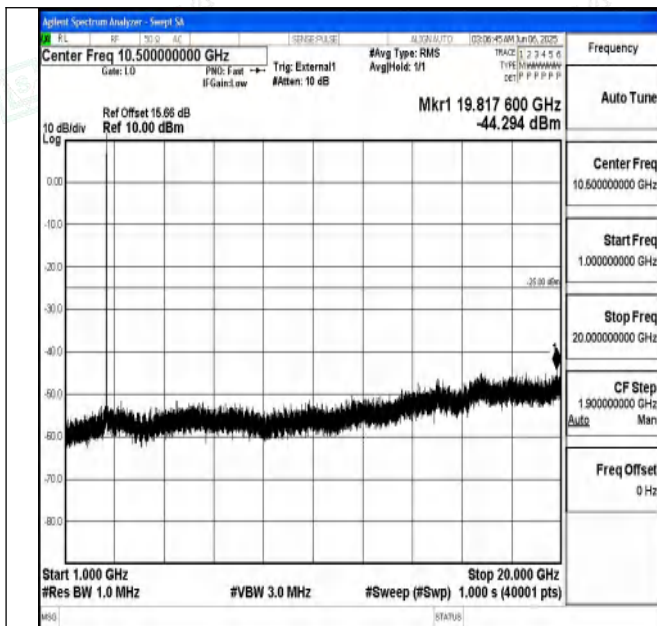


Band41_10MHz_16QAM_40620_1RB#0_1000~20000_1000~20000

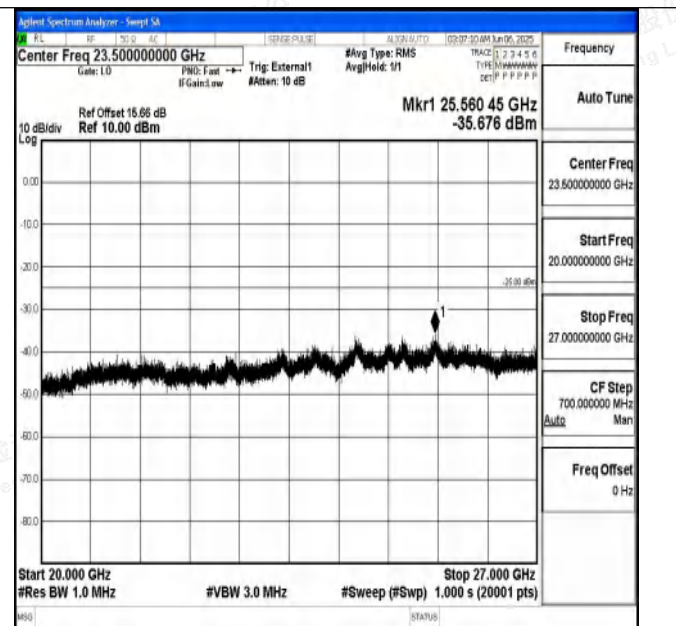

Band41_10MHz_16QAM_40620_1RB#0_20000~27000_20000~27000

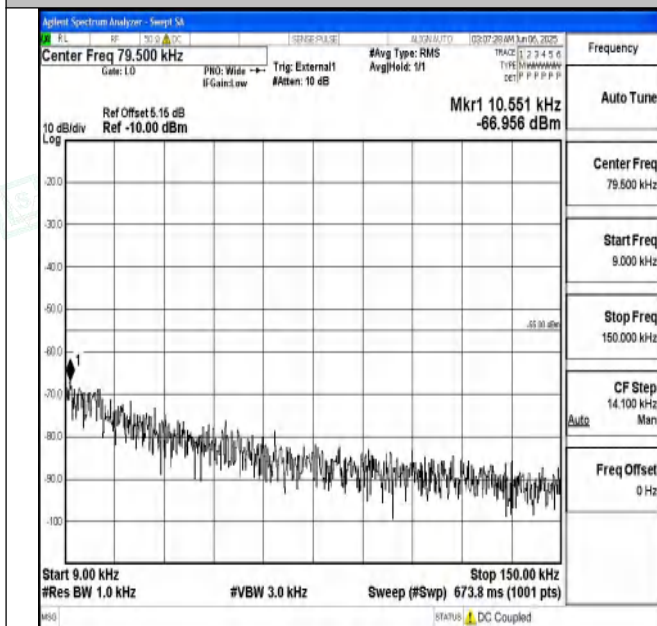

Band41_10MHz_QPSK_41540_1RB#0_0.009~0.15_0.009~0.15

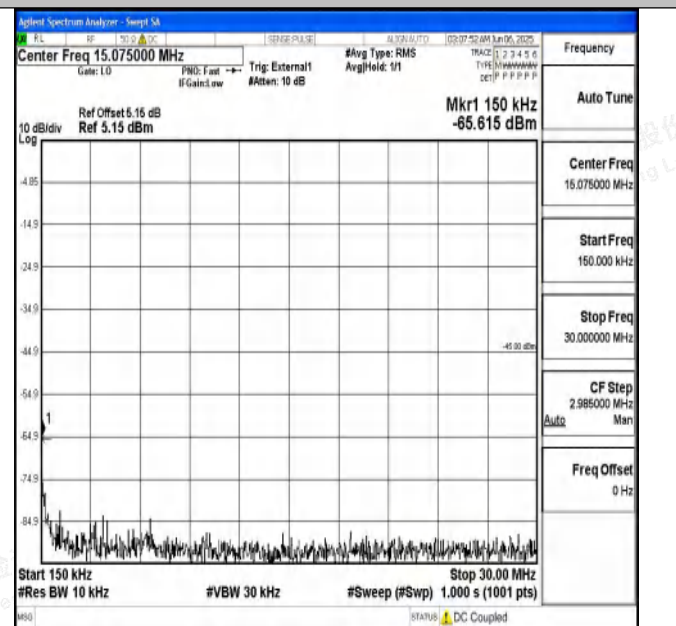

Band41_10MHz_QPSK_41540_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

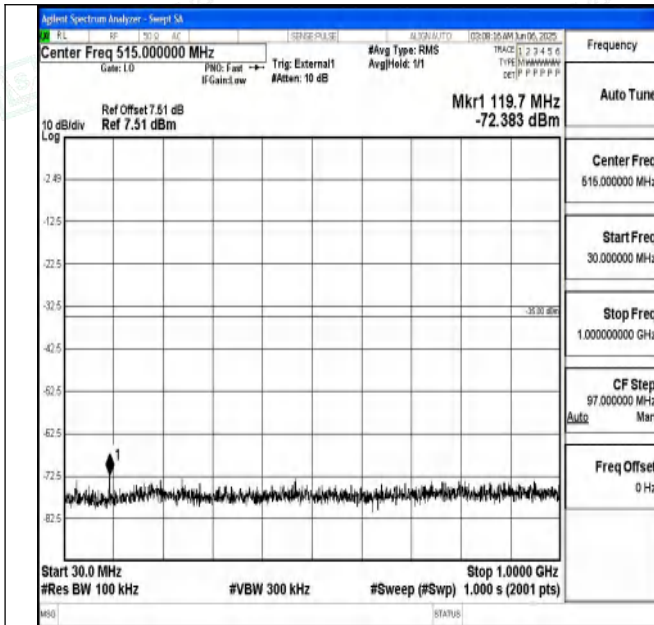


Band41_10MHz_QPSK_41540_1RB#0_30~1000_30~1000

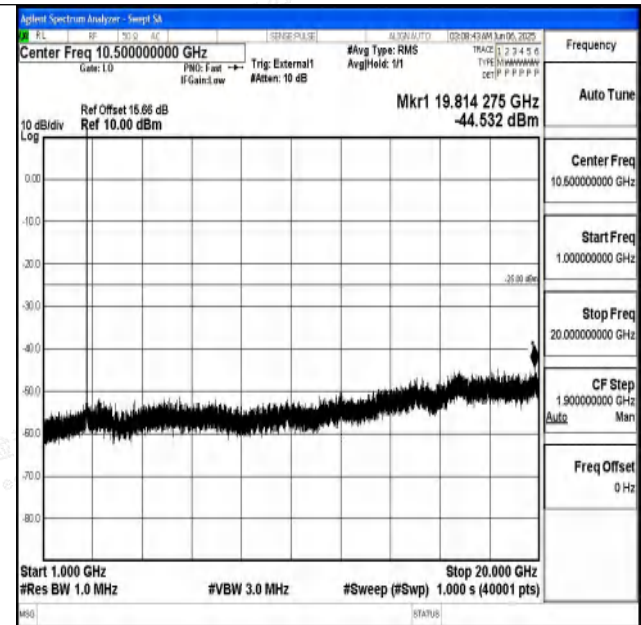

Band41_10MHz_QPSK_41540_1RB#0_1000~20000_1000~20000

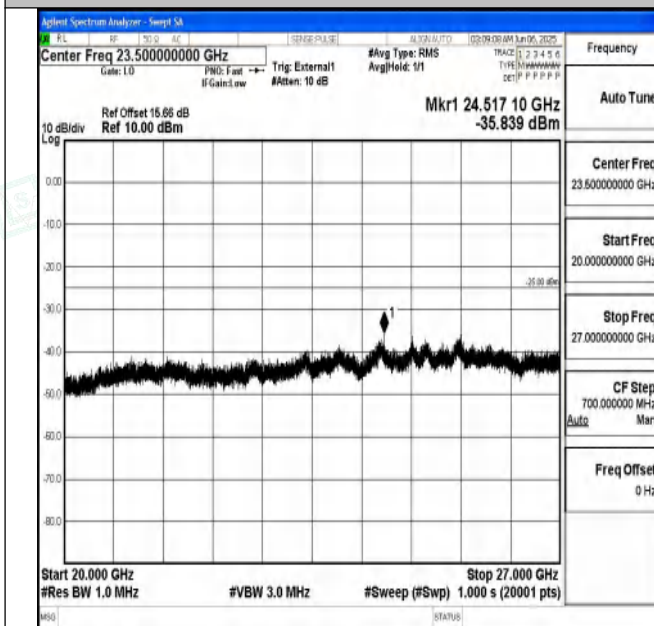

Band41_10MHz_QPSK_41540_1RB#0_20000~27000_20000~27000

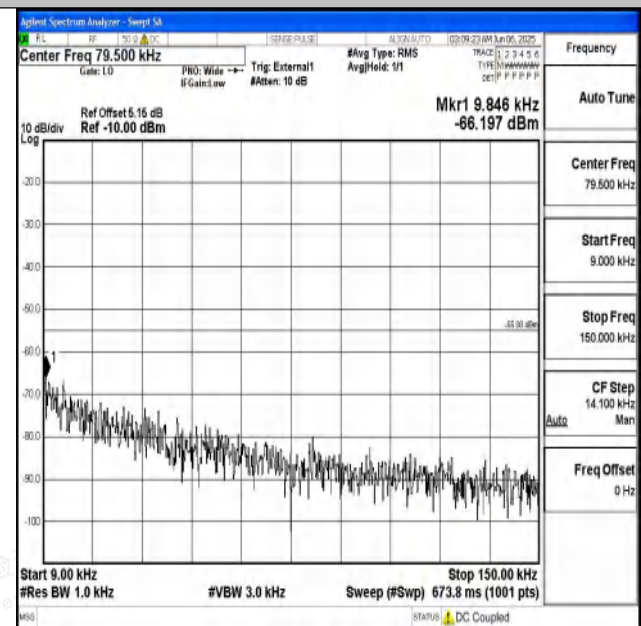

Band41_10MHz_16QAM_41540_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com



Scan code to check authenticity

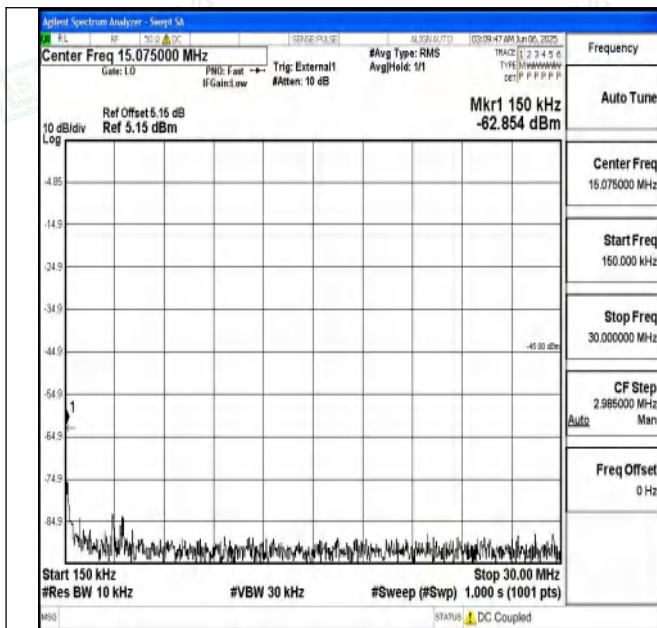

Band41_10MHz_16QAM_41540_1RB#0_0.15~30_0.15~30

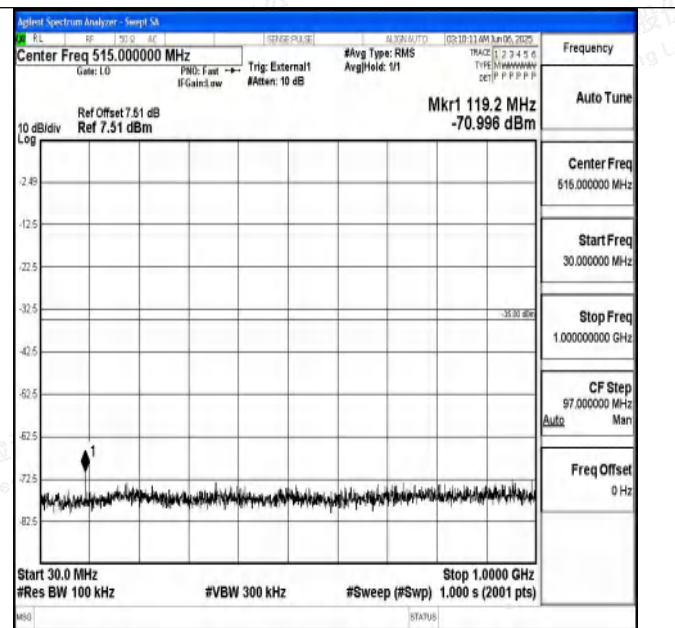

Band41_10MHz_16QAM_41540_1RB#0_30~1000_30~1000

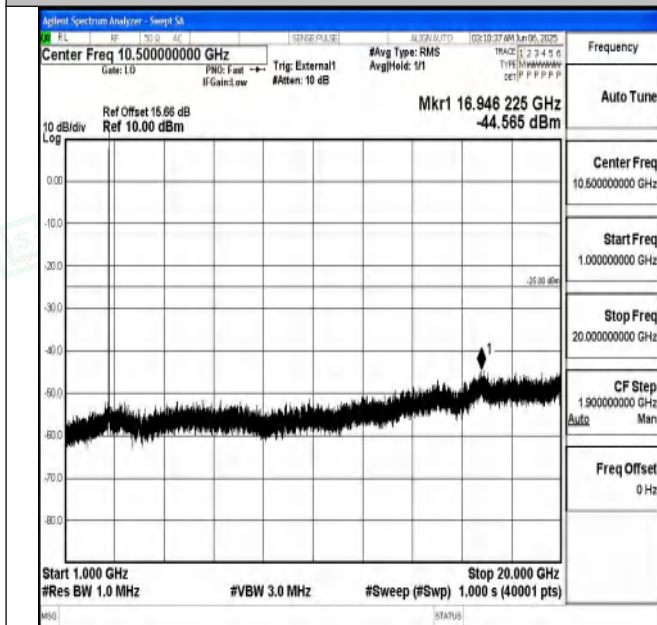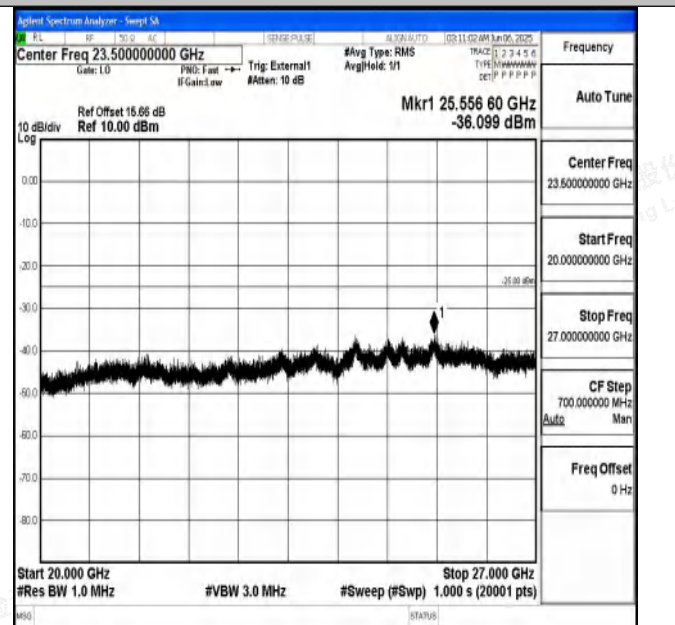
Band41_10MHz_16QAM_41540_1RB#0_1000~20000_1000
~20000Band41_10MHz_16QAM_41540_1RB#0_20000~27000_2000
0~27000

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

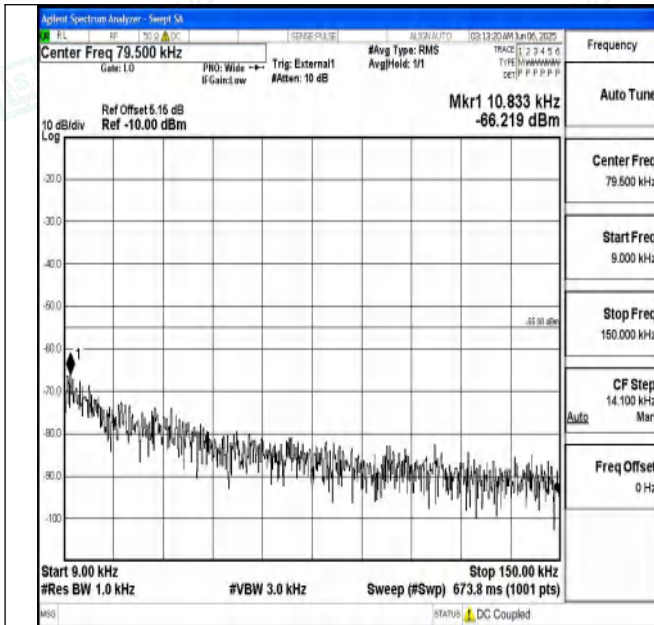

Band41_15MHz_QPSK_39725_1RB#0_0.009~0.15_0.009~0.15

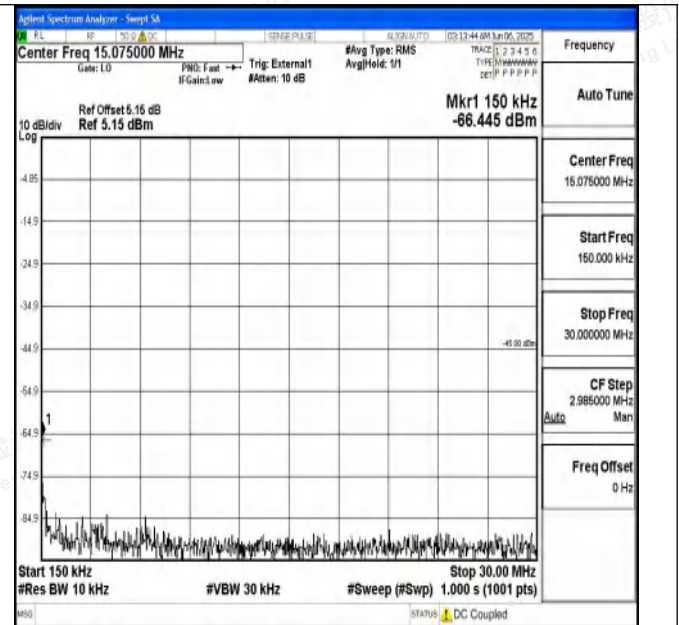

Band41_15MHz_QPSK_39725_1RB#0_0.15~30_0.15~30

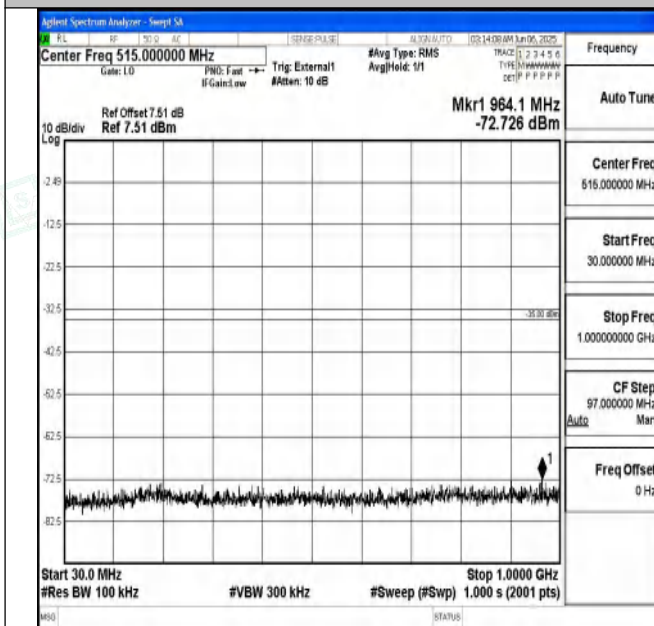

Band41_15MHz_QPSK_39725_1RB#0_30~1000_30~1000

Band41_15MHz_QPSK_39725_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

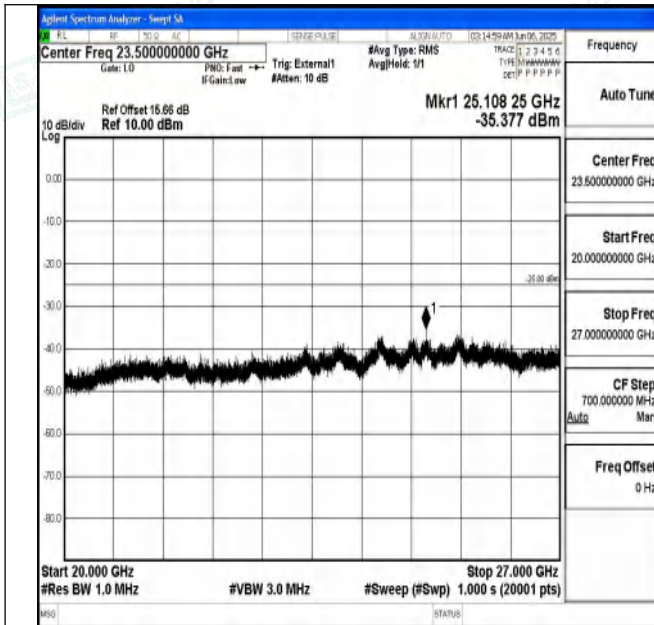


Band41_15MHz_QPSK_39725_1RB#0_20000~27000_2000
0~27000

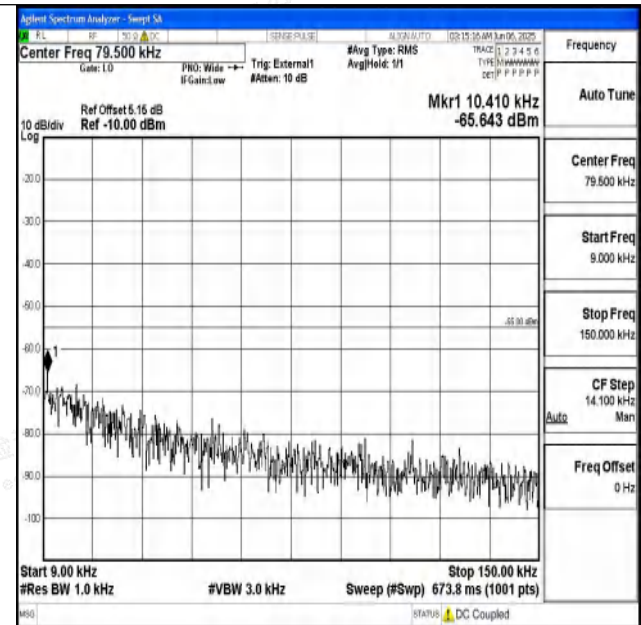

Band41_15MHz_16QAM_39725_1RB#0_0.009~0.15_0.009~0.15

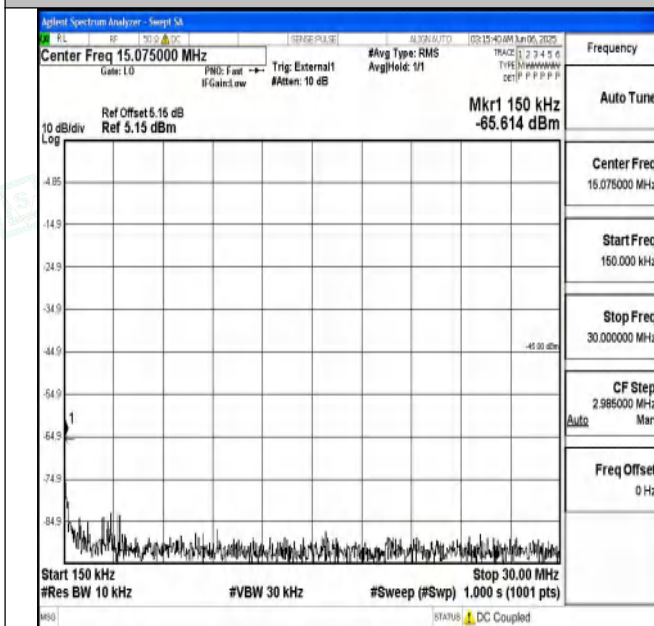

Band41_15MHz_16QAM_39725_1RB#0_0.15~30_0.15~30

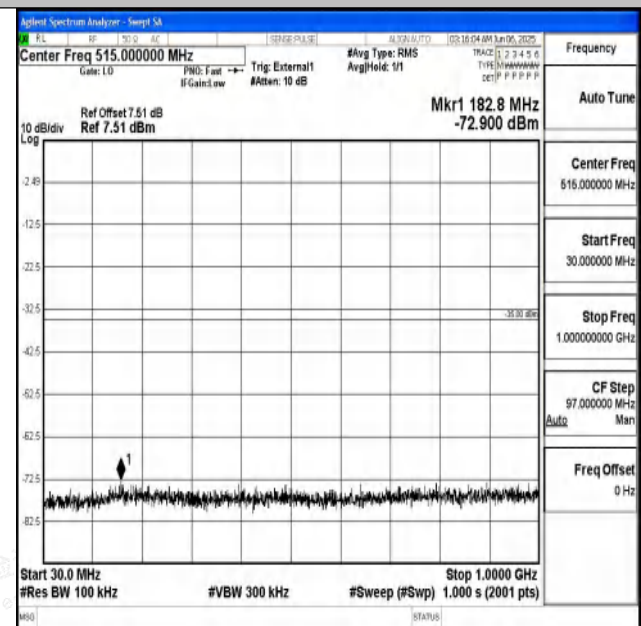

Band41_15MHz_16QAM_39725_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

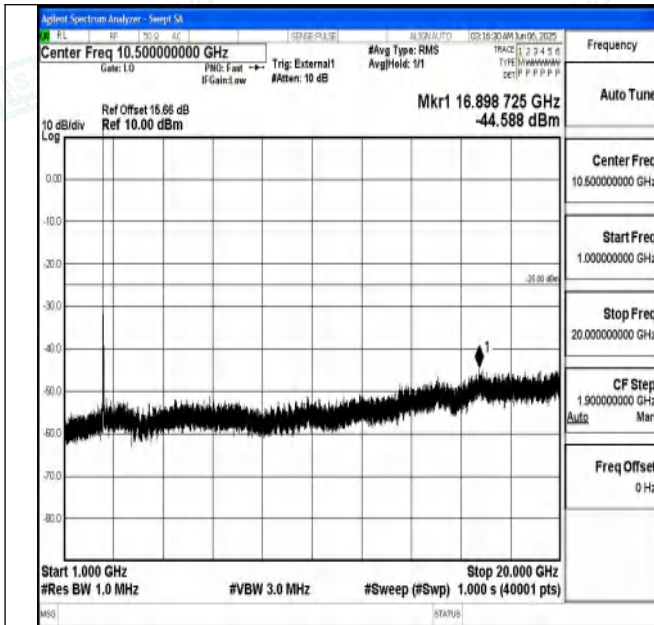


Band41_15MHz_16QAM_39725_1RB#0_1000~20000_1000
~20000

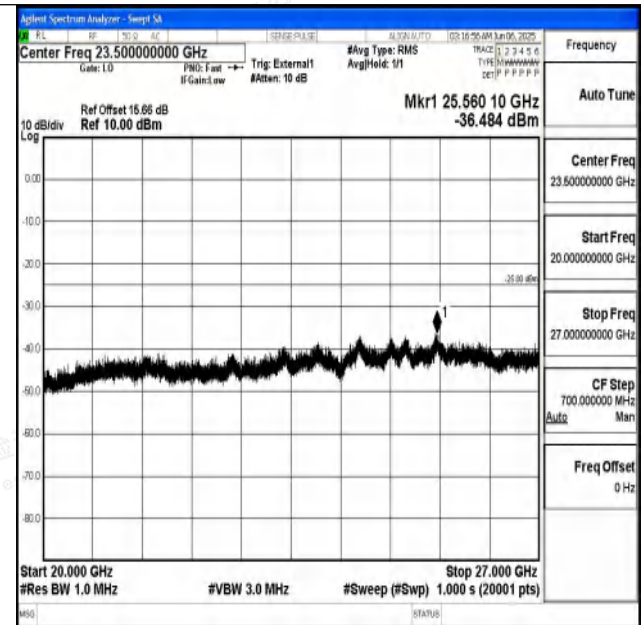

Band41_15MHz_16QAM_39725_1RB#0_20000~27000_2000
0~27000

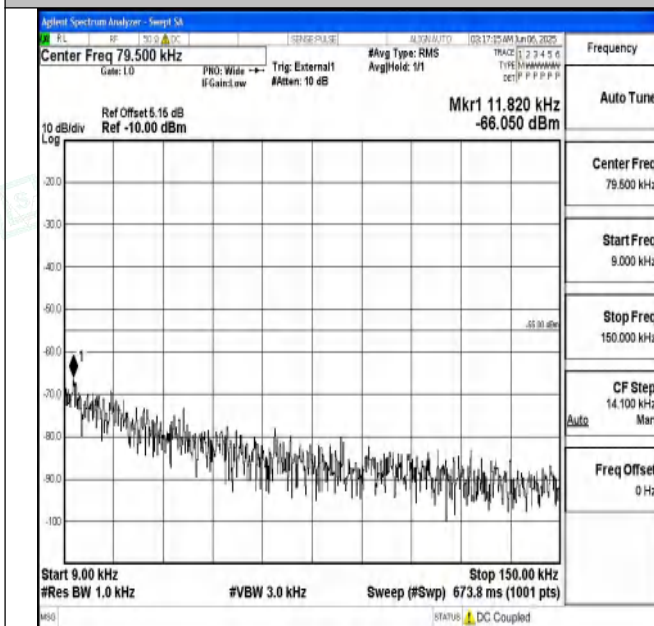

Band41_15MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

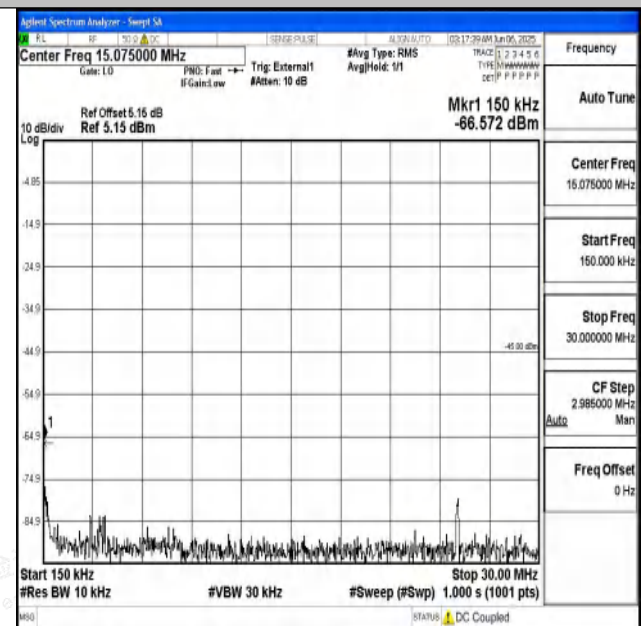

Band41_15MHz_QPSK_40620_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

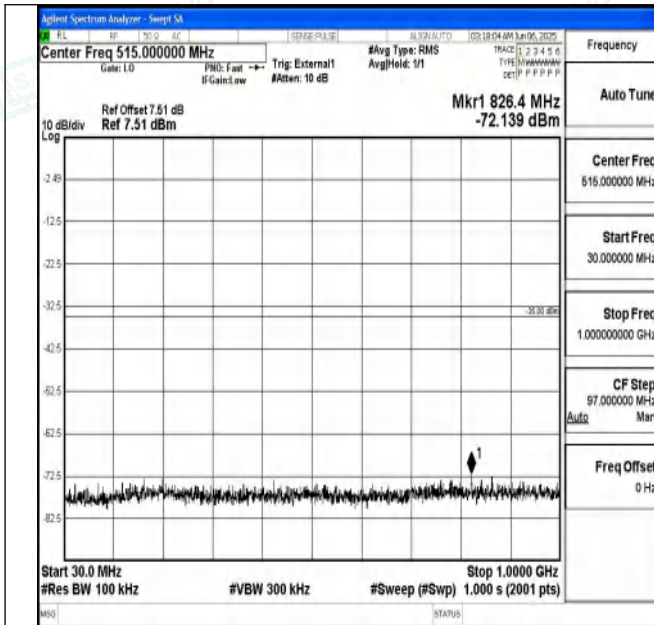


Band41_15MHz_QPSK_40620_1RB#0_30~1000_30~1000

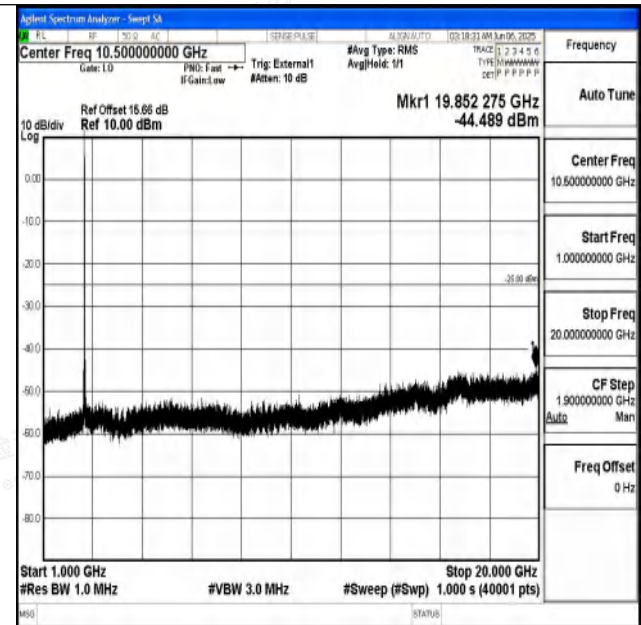

Band41_15MHz_QPSK_40620_1RB#0_1000~20000_1000~20000

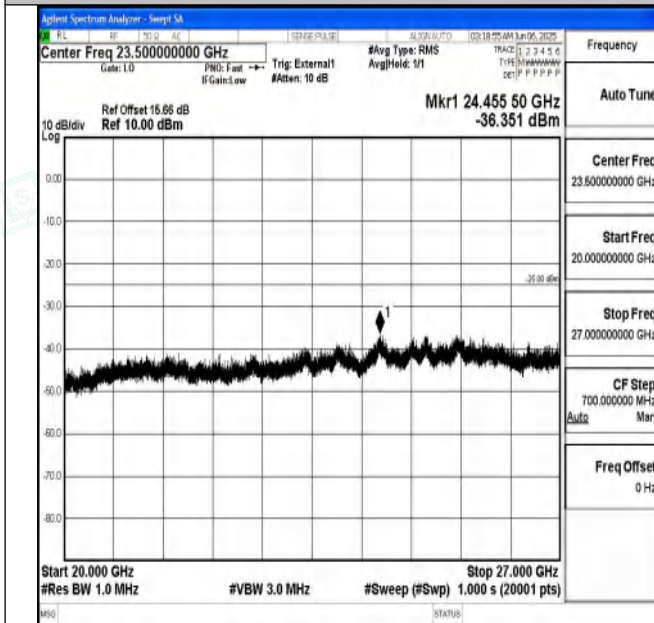

Band41_15MHz_QPSK_40620_1RB#0_20000~27000_20000~27000

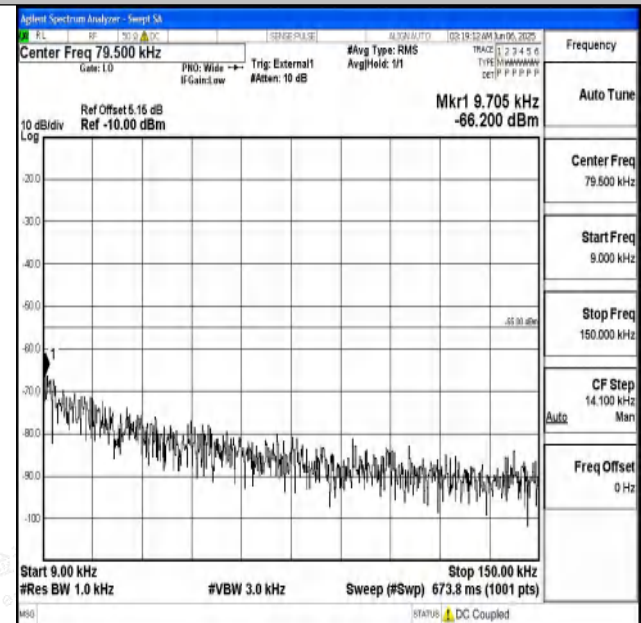

Band41_15MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com



Scan code to check authenticity

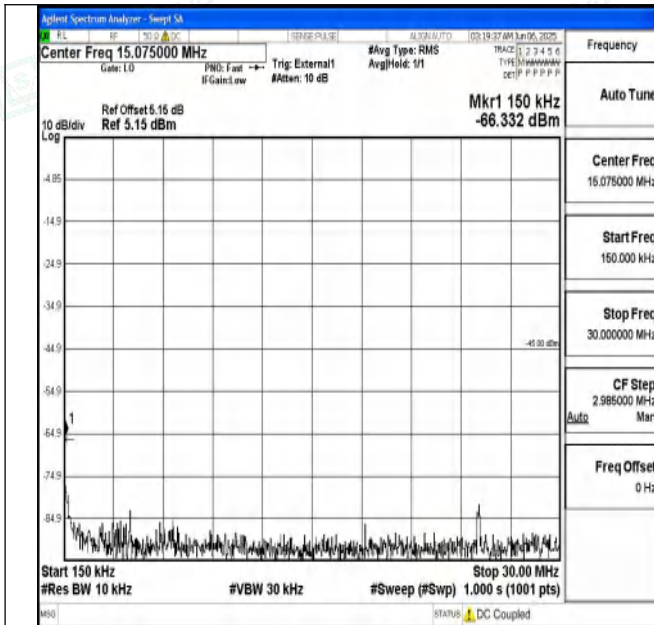

Band41_15MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

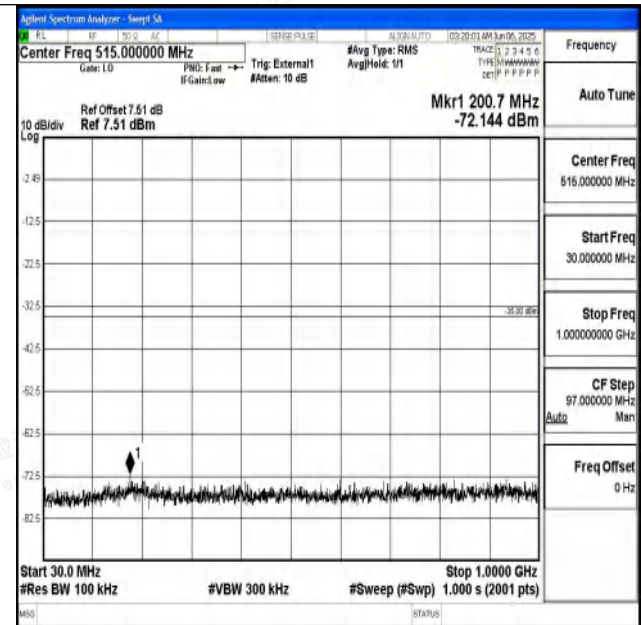

Band41_15MHz_16QAM_40620_1RB#0_30~1000_30~1000

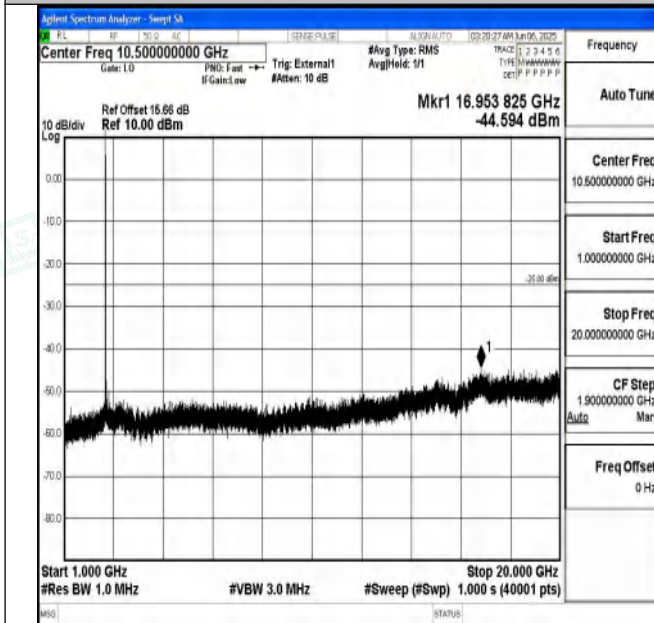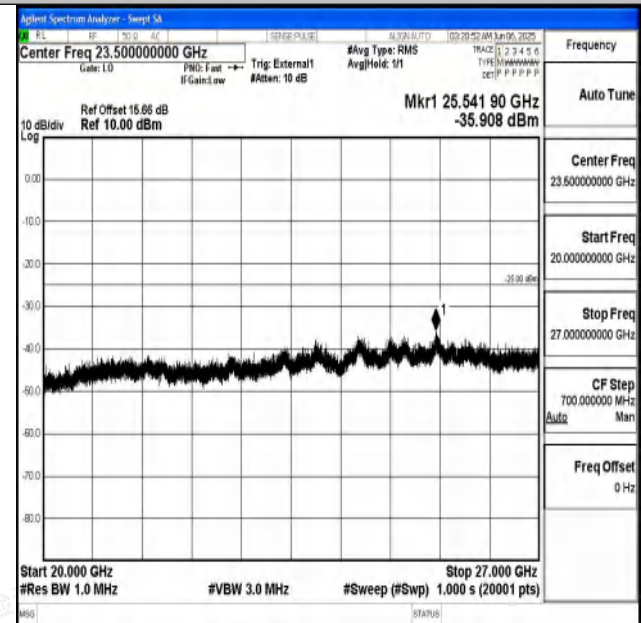
Band41_15MHz_16QAM_40620_1RB#0_1000~20000_1000
~20000Band41_15MHz_16QAM_40620_1RB#0_20000~27000_2000
0~27000

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

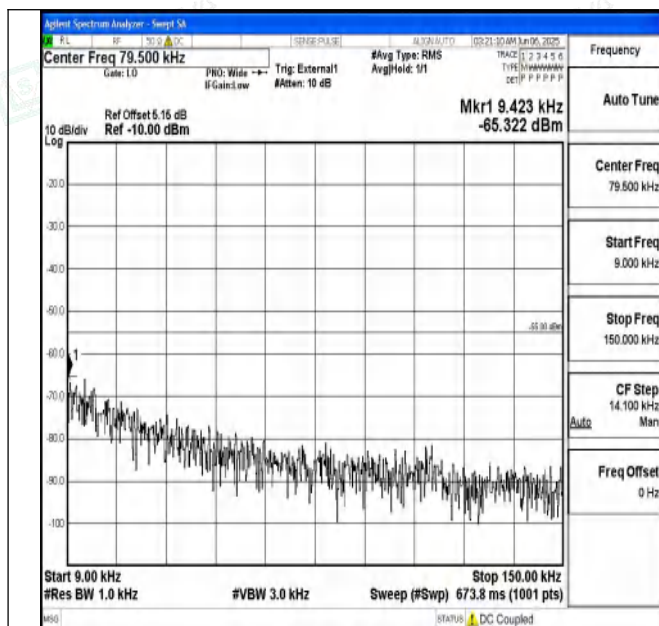


Band41_15MHz_QPSK_41515_1RB#0_0.009~0.15_0.009~0.15

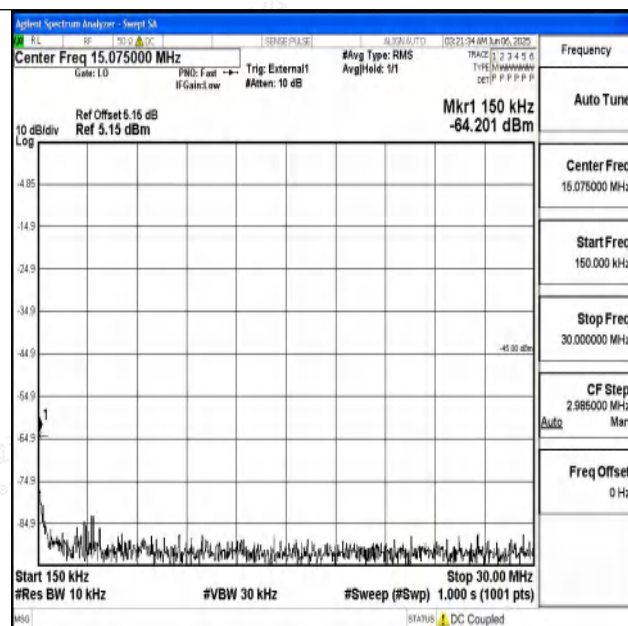

Band41_15MHz_QPSK_41515_1RB#0_0.15~30_0.15~30

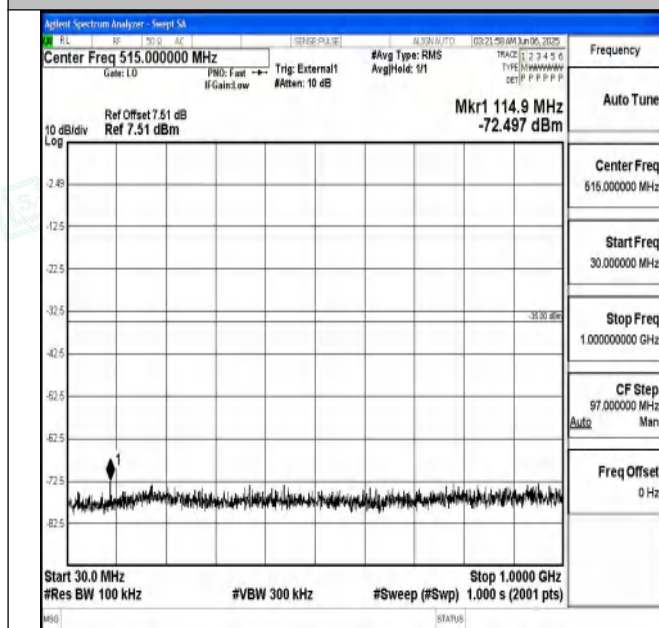

Band41_15MHz_QPSK_41515_1RB#0_30~1000_30~1000

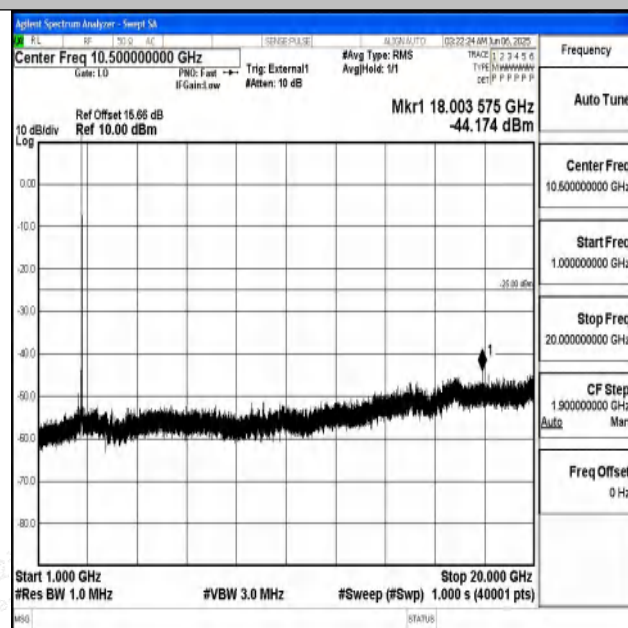

Band41_15MHz_QPSK_41515_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

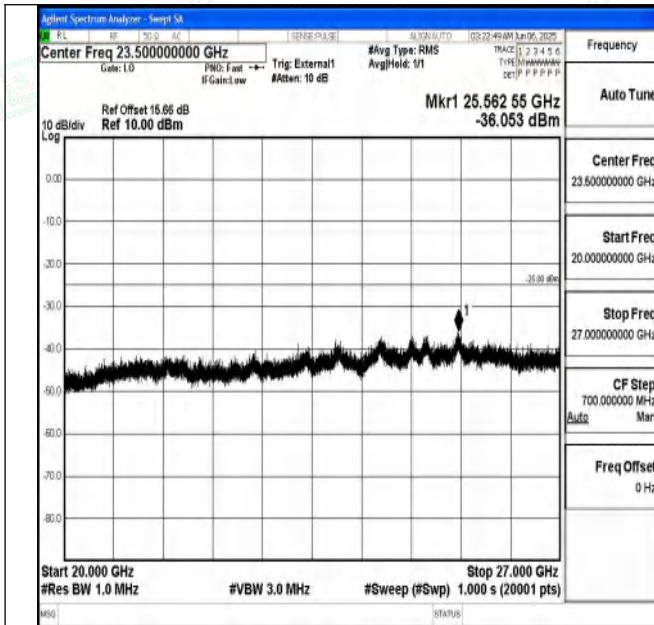


Band41_15MHz_QPSK_41515_1RB#0_20000~27000_2000
0~27000

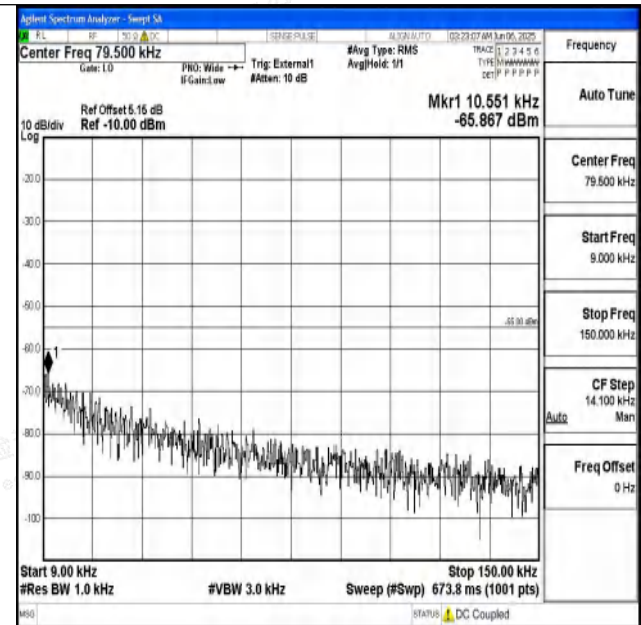

Band41_15MHz_16QAM_41515_1RB#0_0.009~0.15_0.009~0.15

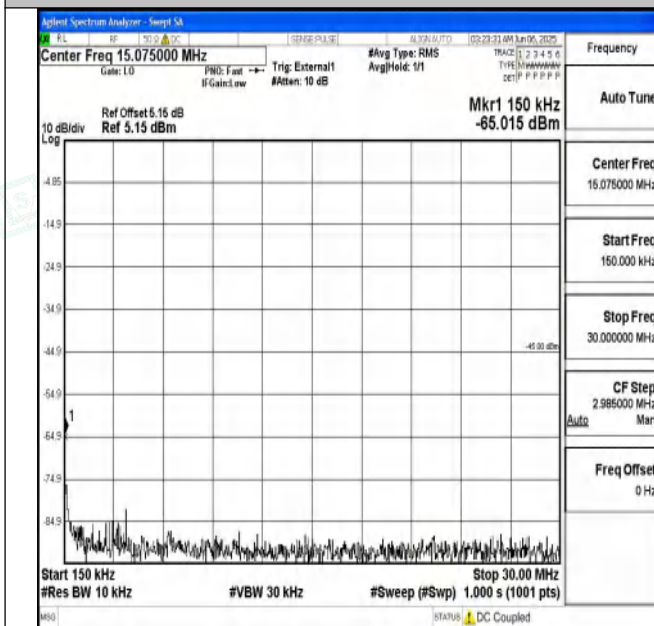

Band41_15MHz_16QAM_41515_1RB#0_0.15~30_0.15~30

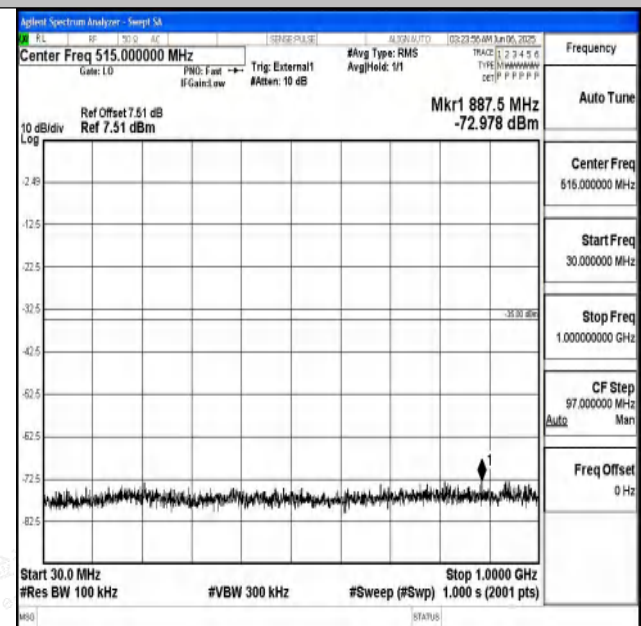

Band41_15MHz_16QAM_41515_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

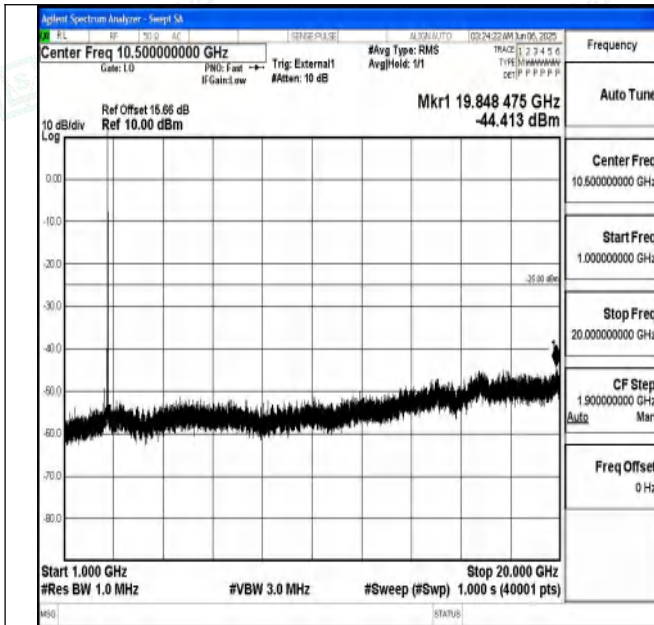


Band41_15MHz_16QAM_41515_1RB#0_1000~20000_1000
~20000

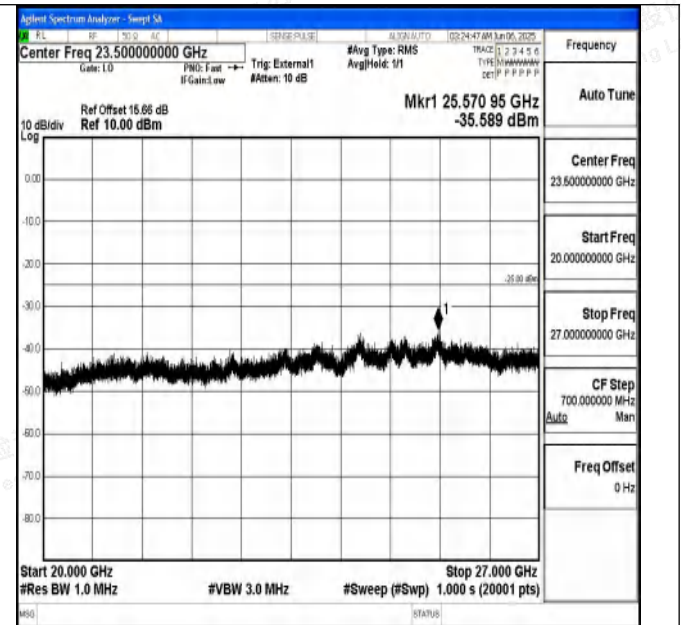

Band41_15MHz_16QAM_41515_1RB#0_20000~27000_2000
0~27000

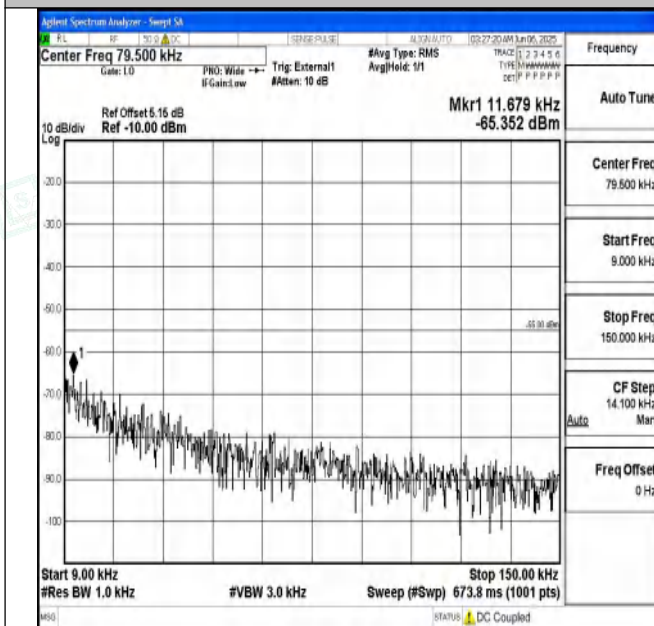

Band41_20MHz_QPSK_39750_1RB#0_0.009~0.15_0.009~0
.15

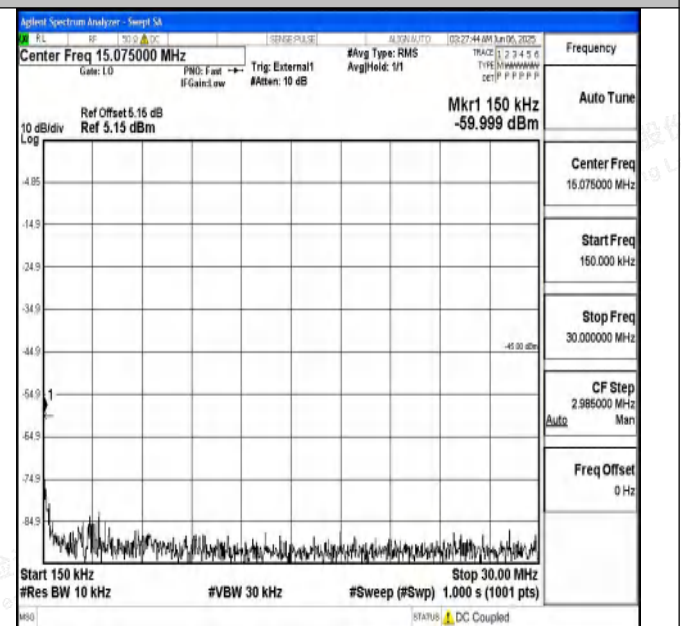

Band41_20MHz_QPSK_39750_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

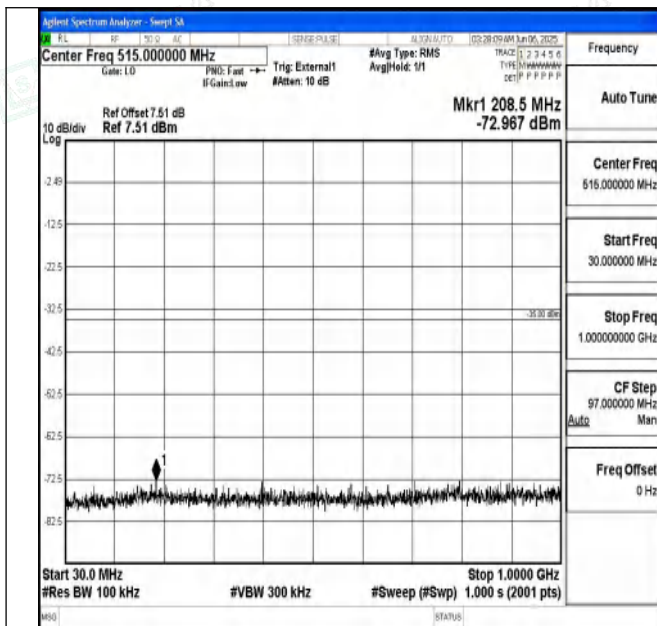


Band41_20MHz_QPSK_39750_1RB#0_30~1000_30~1000

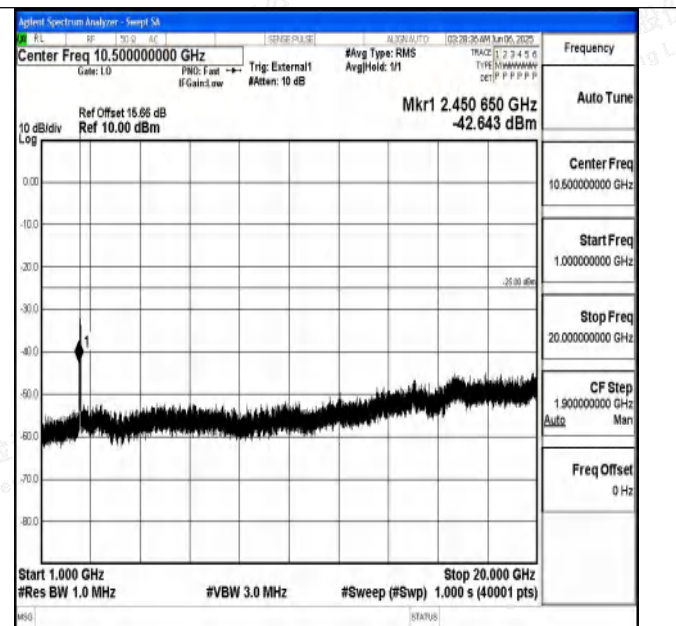

Band41_20MHz_QPSK_39750_1RB#0_1000~20000_1000~20000

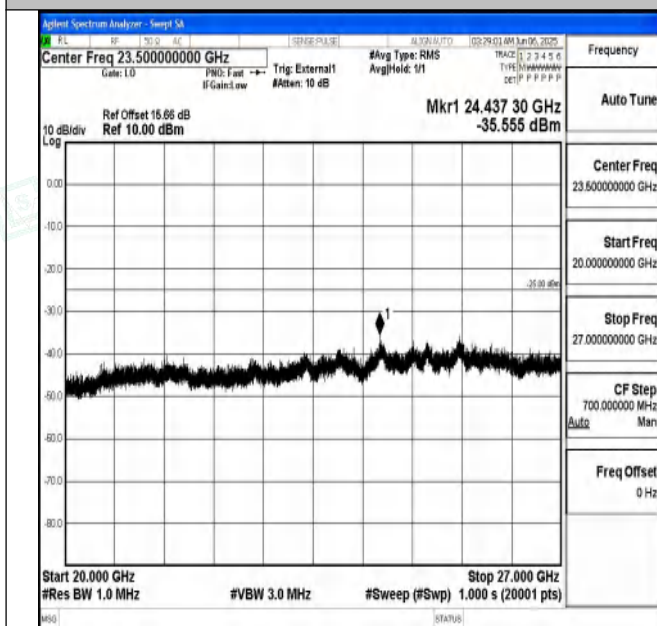

Band41_20MHz_QPSK_39750_1RB#0_20000~27000_20000~27000

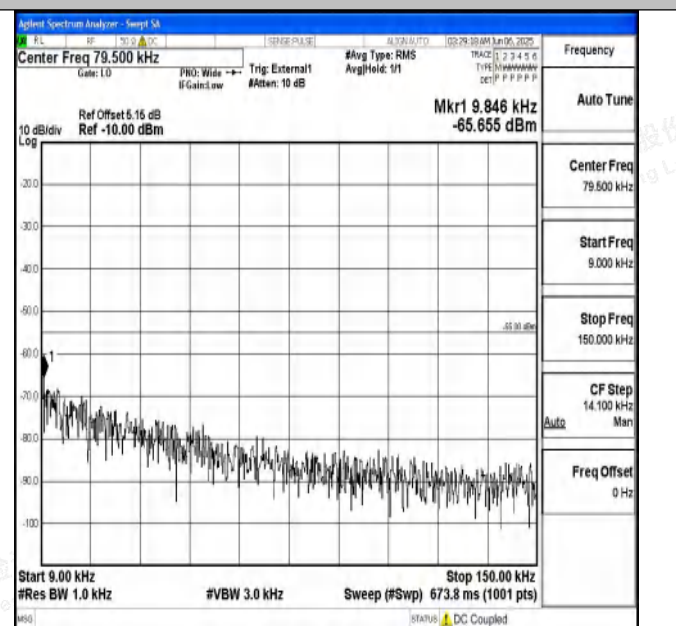

Band41_20MHz_16QAM_39750_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com



Scan code to check authenticity

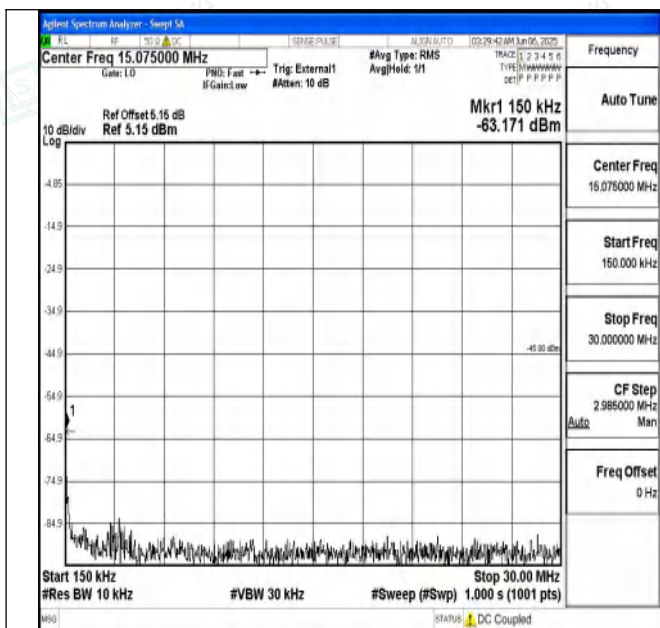

Band41_20MHz_16QAM_39750_1RB#0_0.15~30_0.15~30

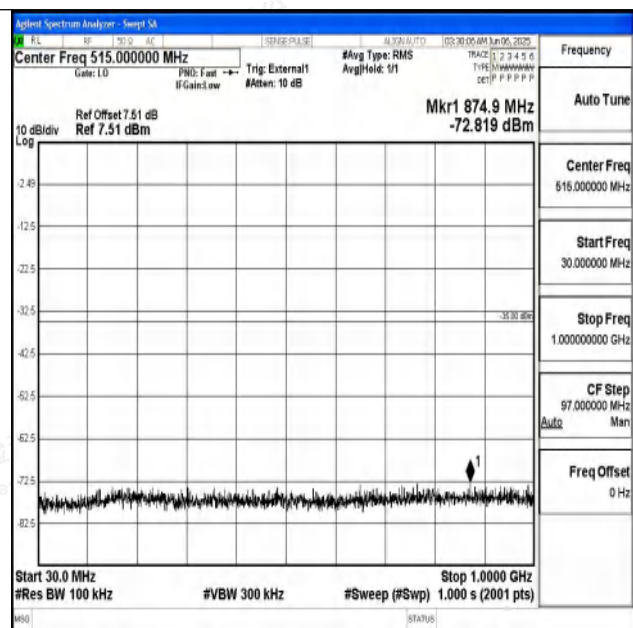

Band41_20MHz_16QAM_39750_1RB#0_30~1000_30~1000

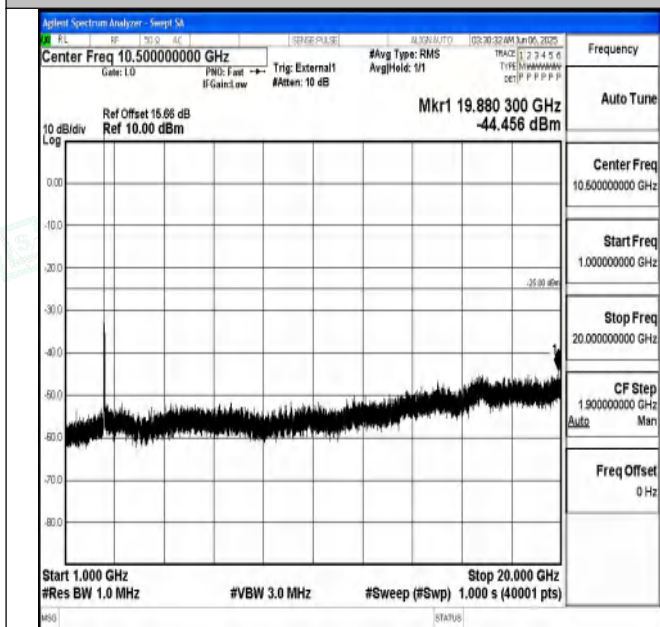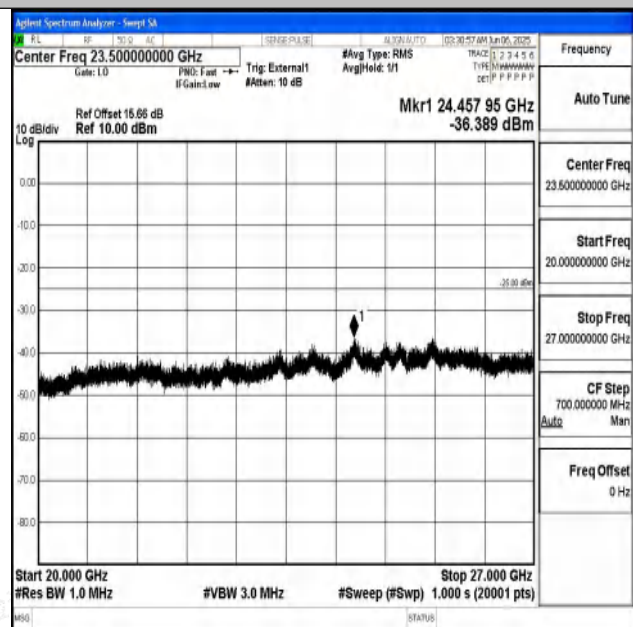
Band41_20MHz_16QAM_39750_1RB#0_1000~20000_1000
~20000Band41_20MHz_16QAM_39750_1RB#0_20000~27000_2000
0~27000

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

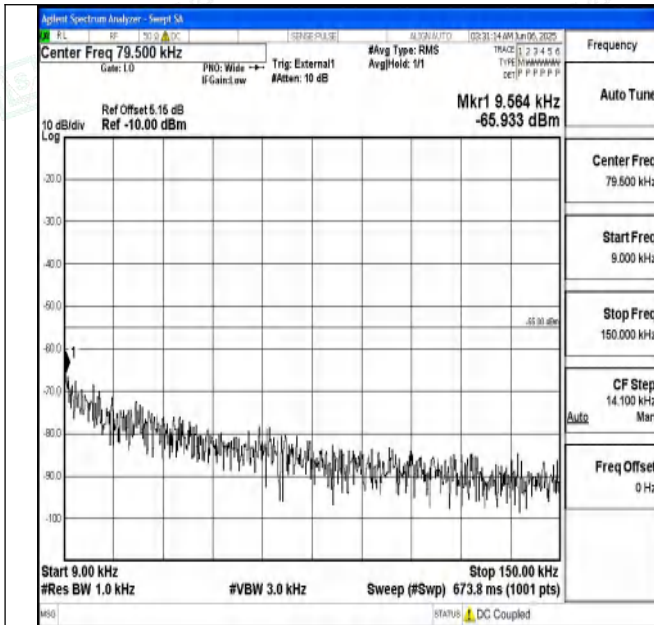


Band41_20MHz_QPSK_40620_1RB#0_0.009~0.15_0.009~0.15

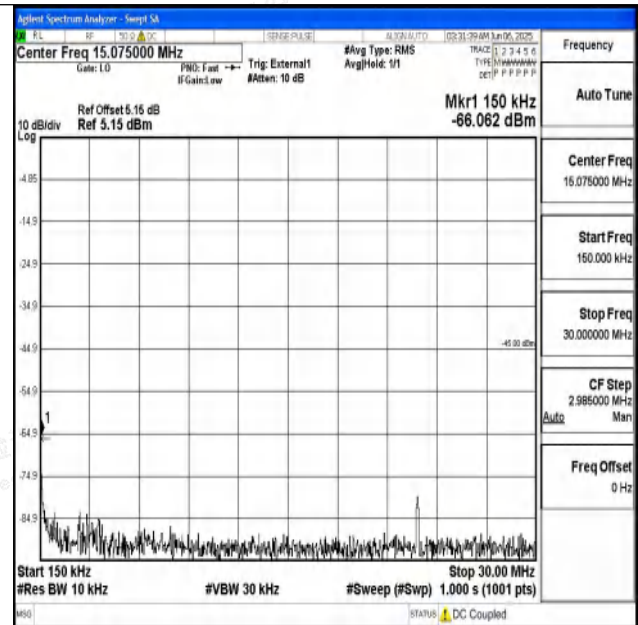

Band41_20MHz_QPSK_40620_1RB#0_0.15~30_0.15~30

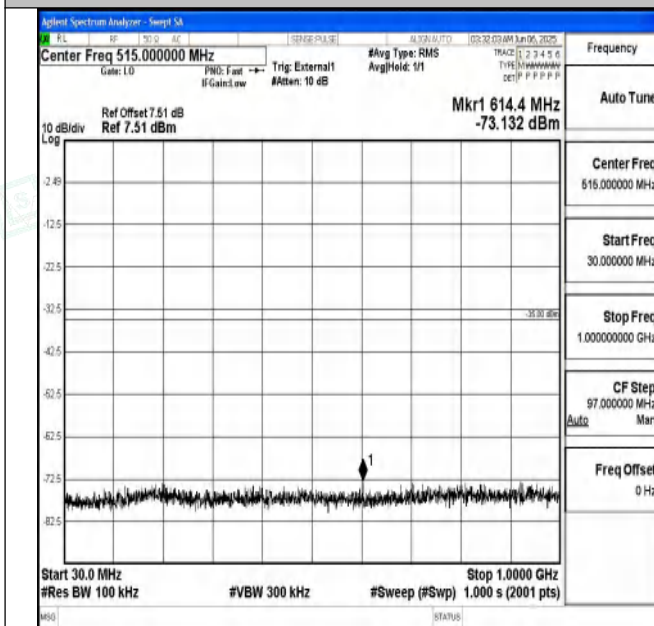

Band41_20MHz_QPSK_40620_1RB#0_30~1000_30~1000

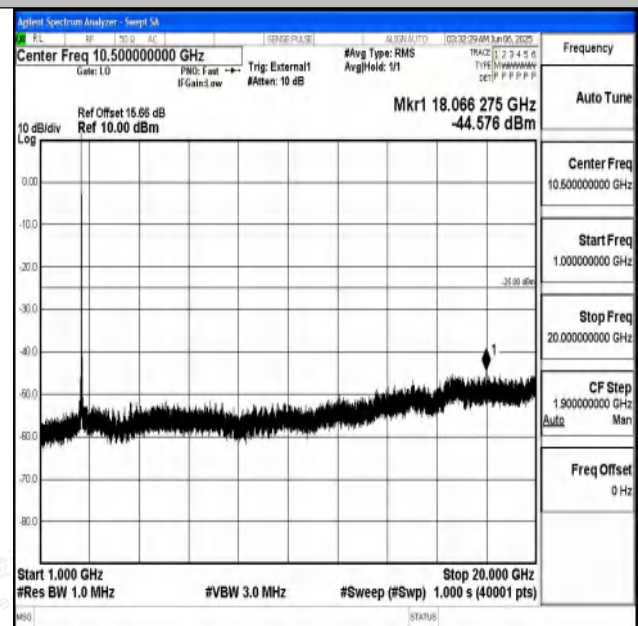

Band41_20MHz_QPSK_40620_1RB#0_1000~20000_1000~20000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

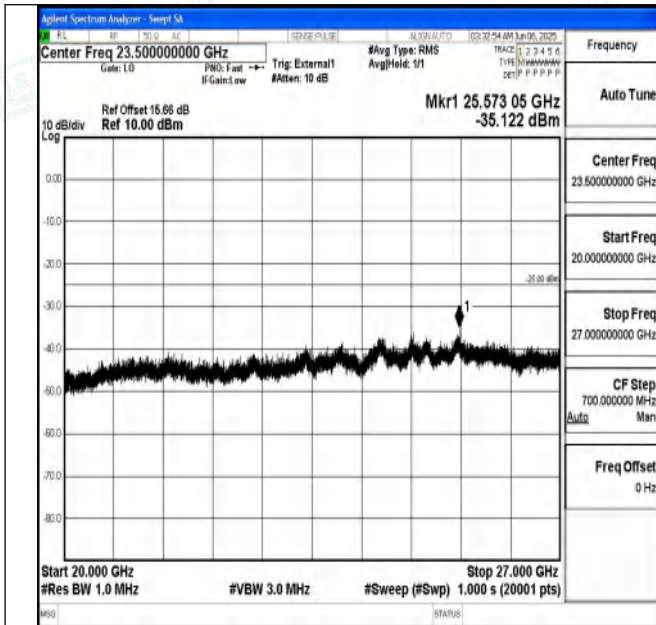


Band41_20MHz_QPSK_40620_1RB#0_20000~27000_2000
0~27000

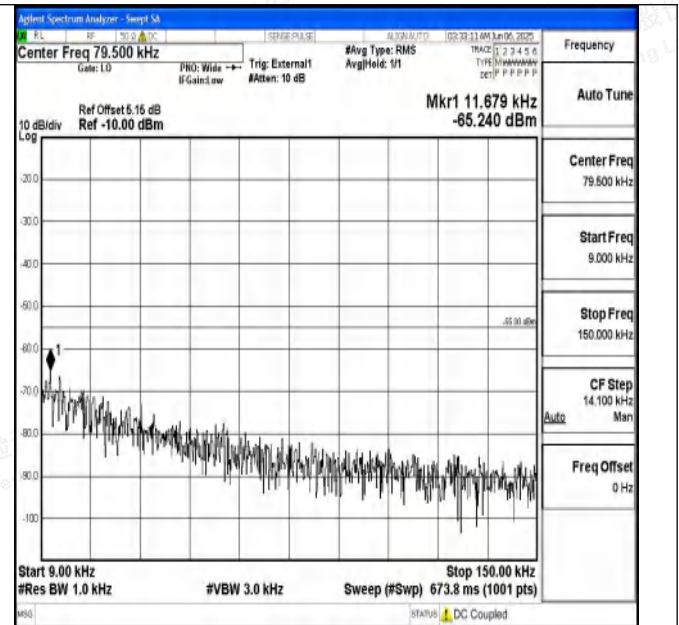

Band41_20MHz_16QAM_40620_1RB#0_0.009~0.15_0.009~0.15

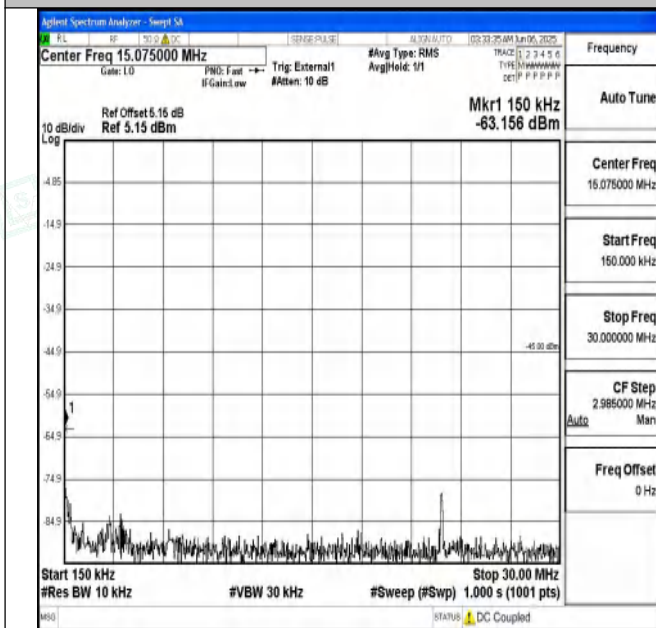

Band41_20MHz_16QAM_40620_1RB#0_0.15~30_0.15~30

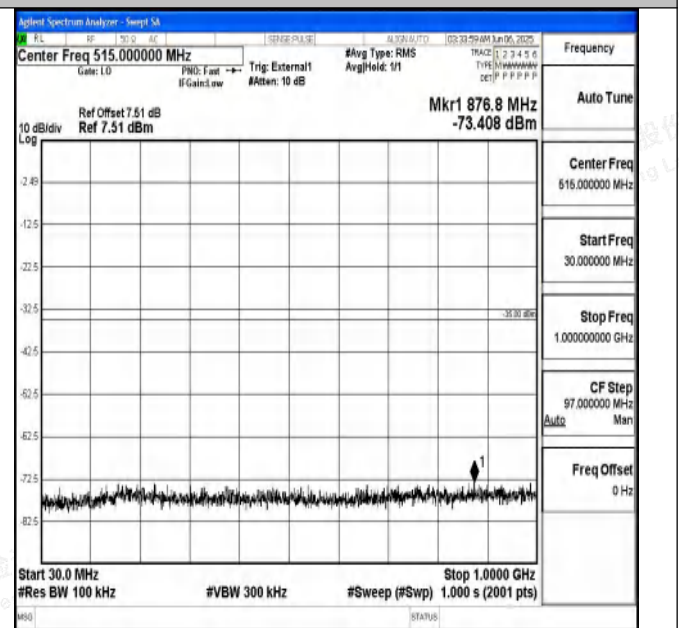

Band41_20MHz_16QAM_40620_1RB#0_30~1000_30~1000




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

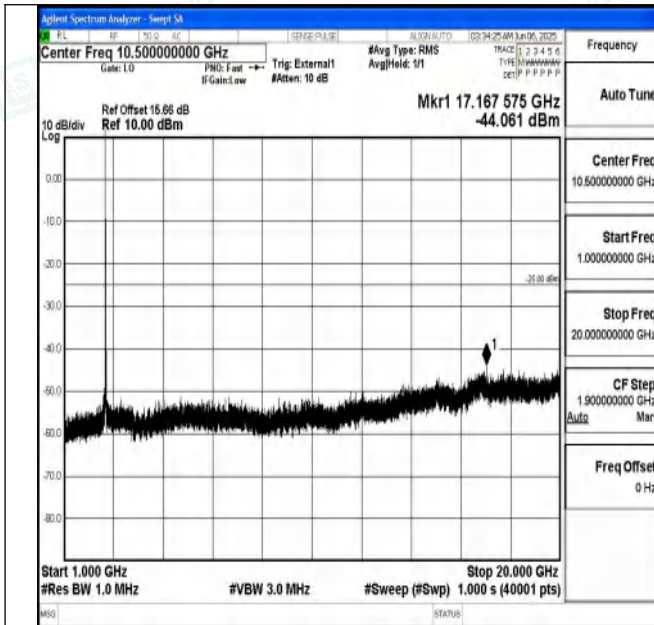


Band41_20MHz_16QAM_40620_1RB#0_1000~20000_1000
~20000

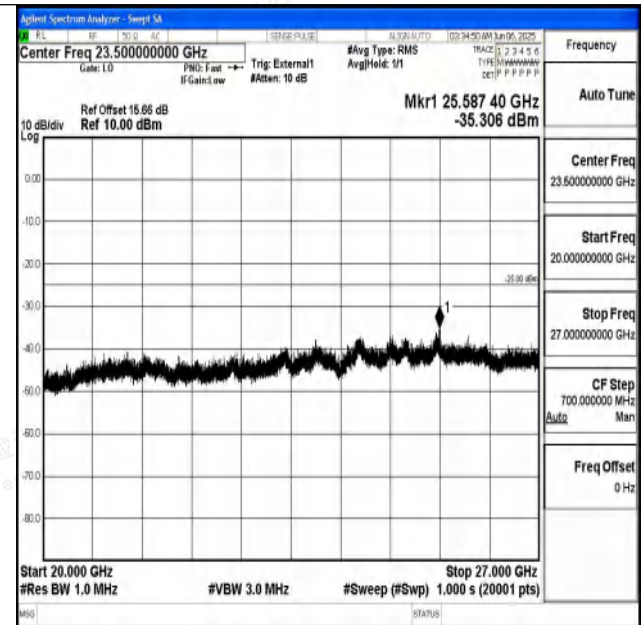

Band41_20MHz_16QAM_40620_1RB#0_20000~27000_2000
0~27000

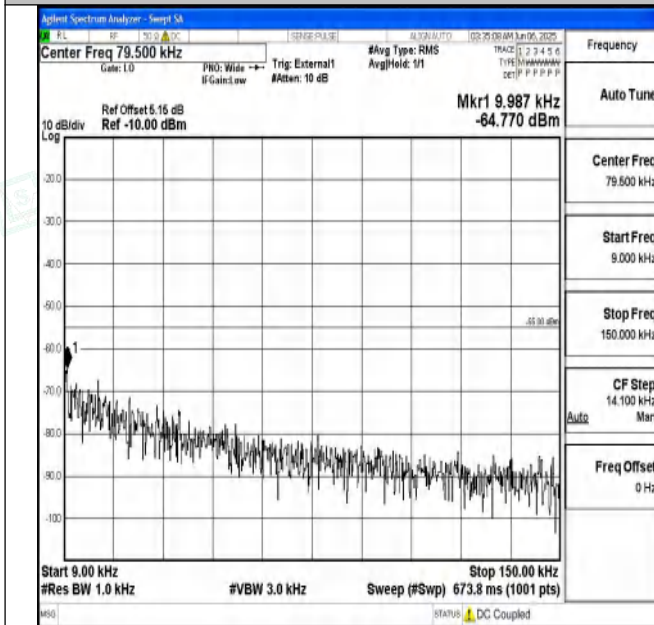

Band41_20MHz_QPSK_41490_1RB#0_0.009~0.15_0.009~0.15

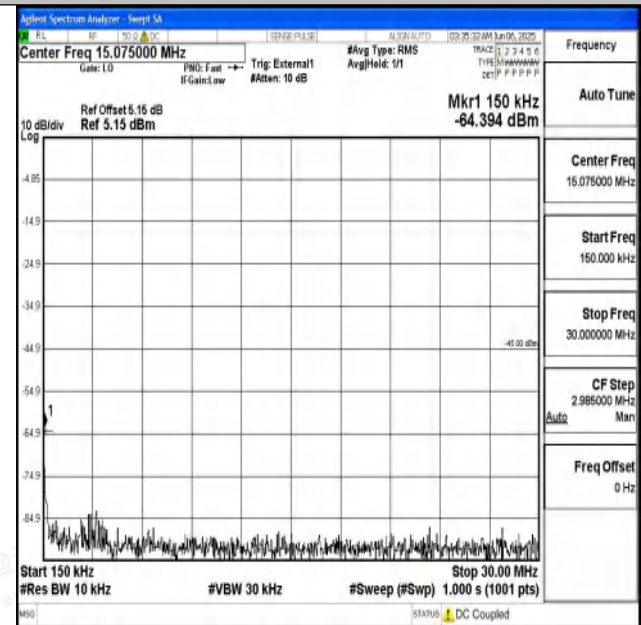

Band41_20MHz_QPSK_41490_1RB#0_0.15~30_0.15~30




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

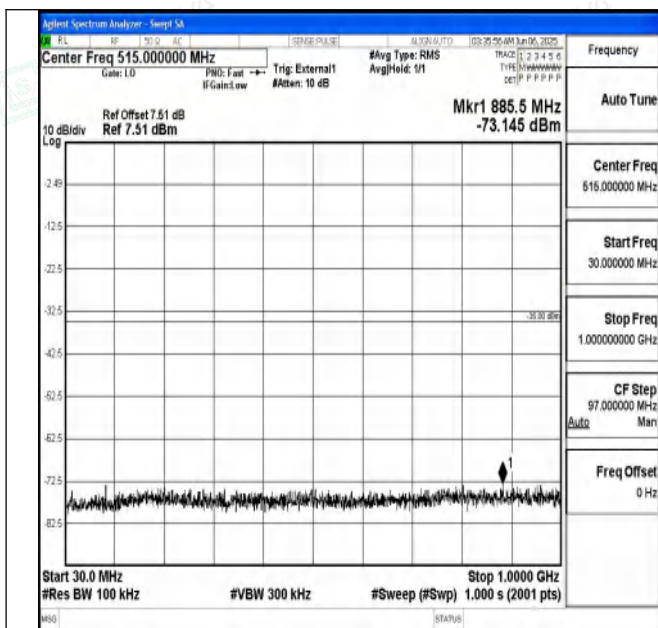


Band41_20MHz_QPSK_41490_1RB#0_30~1000_30~1000

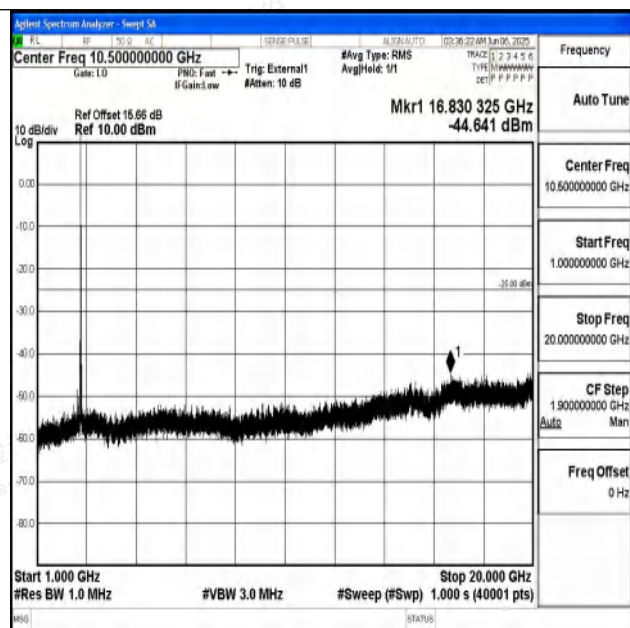

Band41_20MHz_QPSK_41490_1RB#0_1000~20000_1000~20000

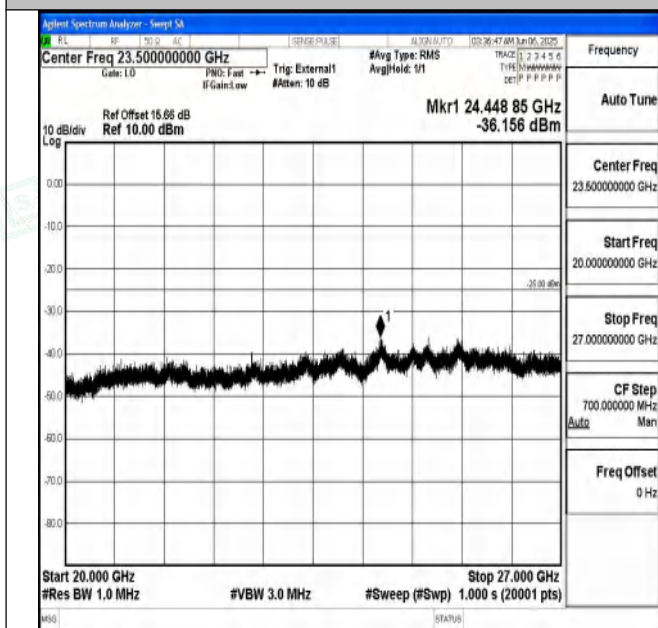

Band41_20MHz_QPSK_41490_1RB#0_20000~27000_20000~27000

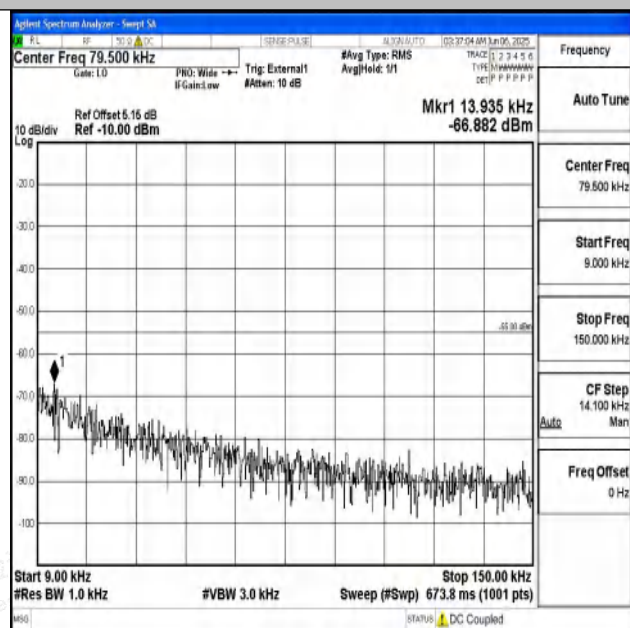

Band41_20MHz_16QAM_41490_1RB#0_0.009~0.15_0.009~0.15




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com



Scan code to check authenticity

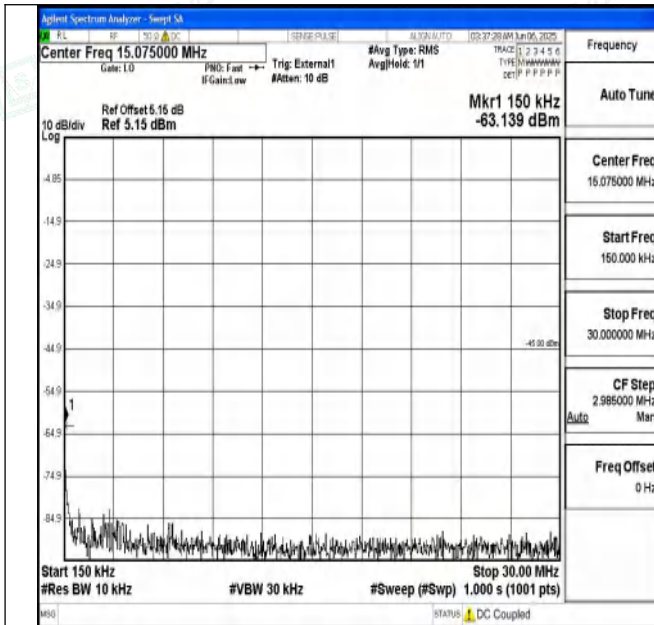

Band41_20MHz_16QAM_41490_1RB#0_0.15~30_0.15~30

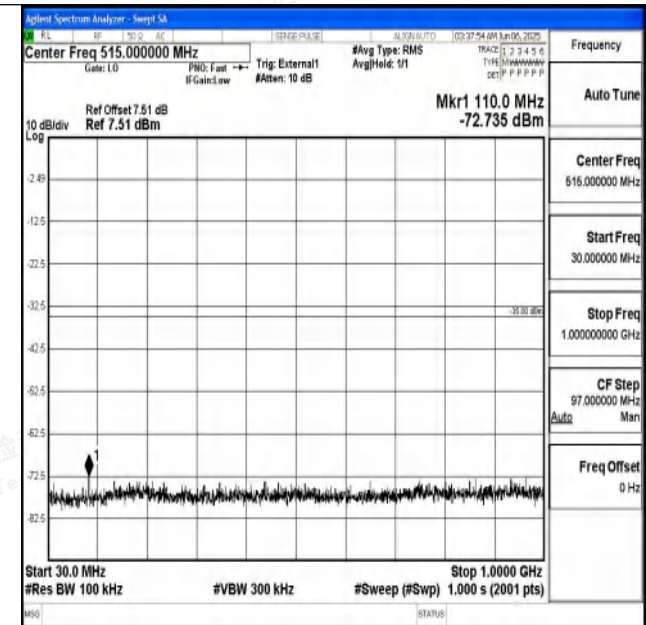

Band41_20MHz_16QAM_41490_1RB#0_30~1000_30~1000

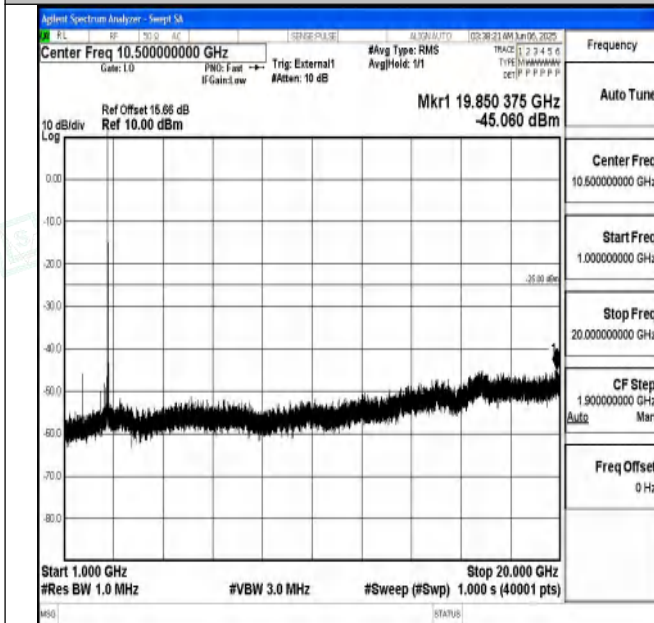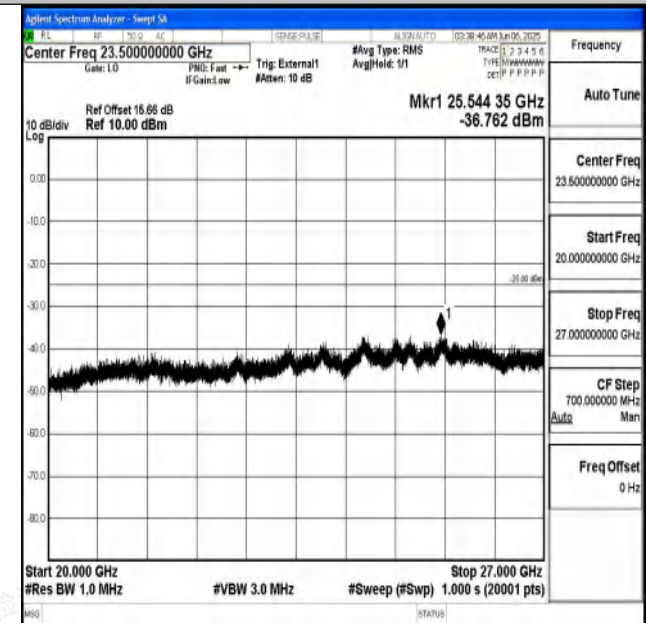Band41_20MHz_16QAM_41490_1RB#0_1000~20000_1000
~20000Band41_20MHz_16QAM_41490_1RB#0_20000~27000_2000
0~27000

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity