




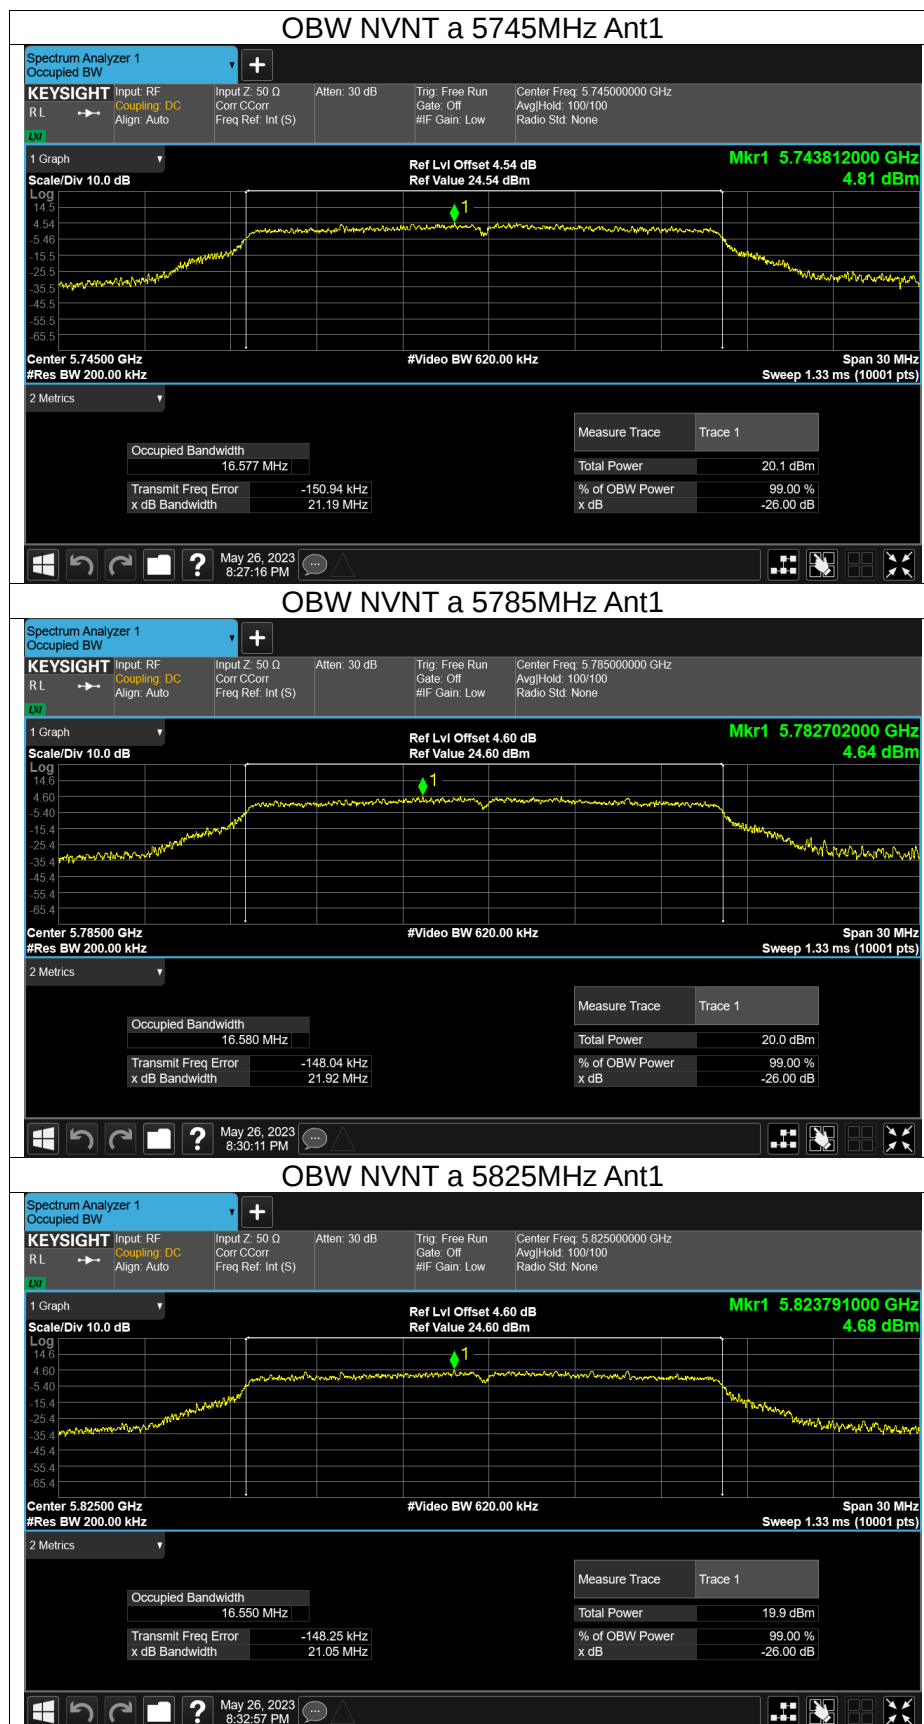


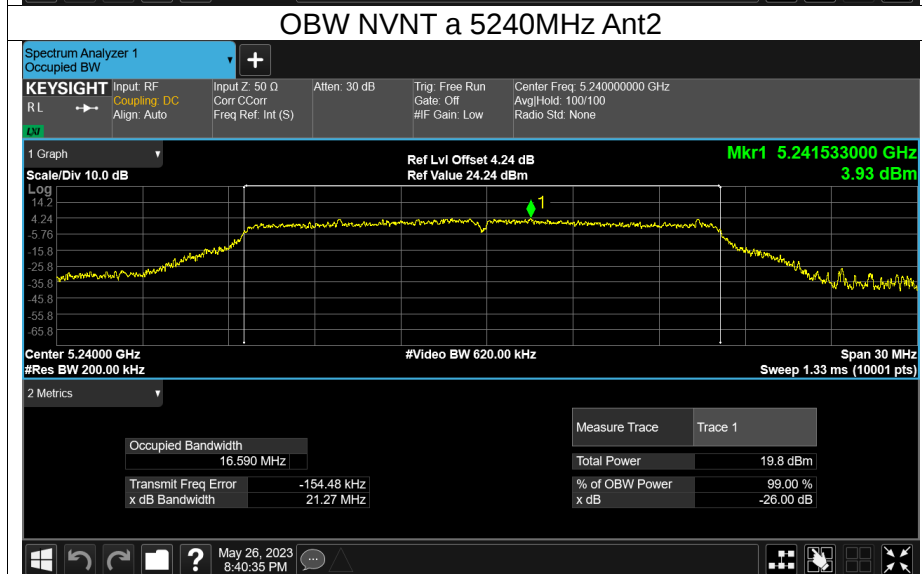

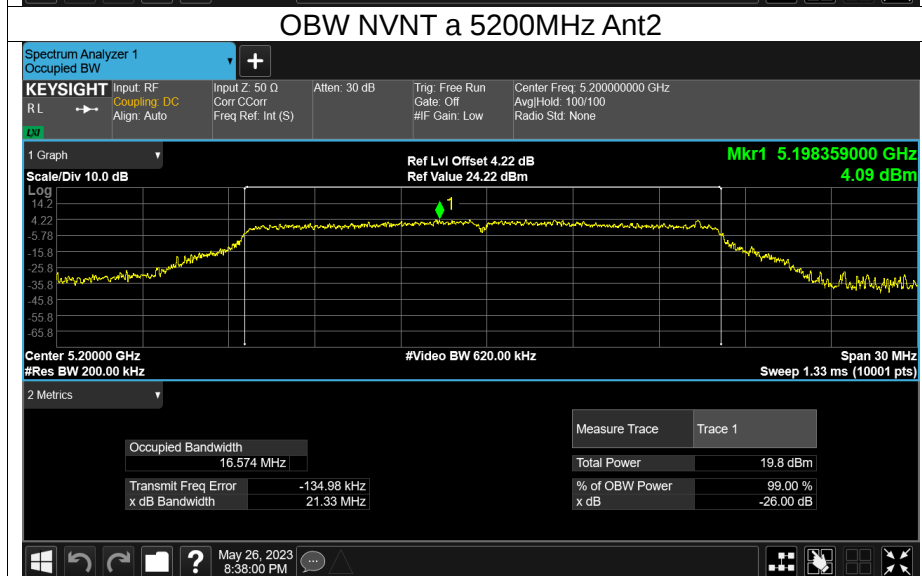

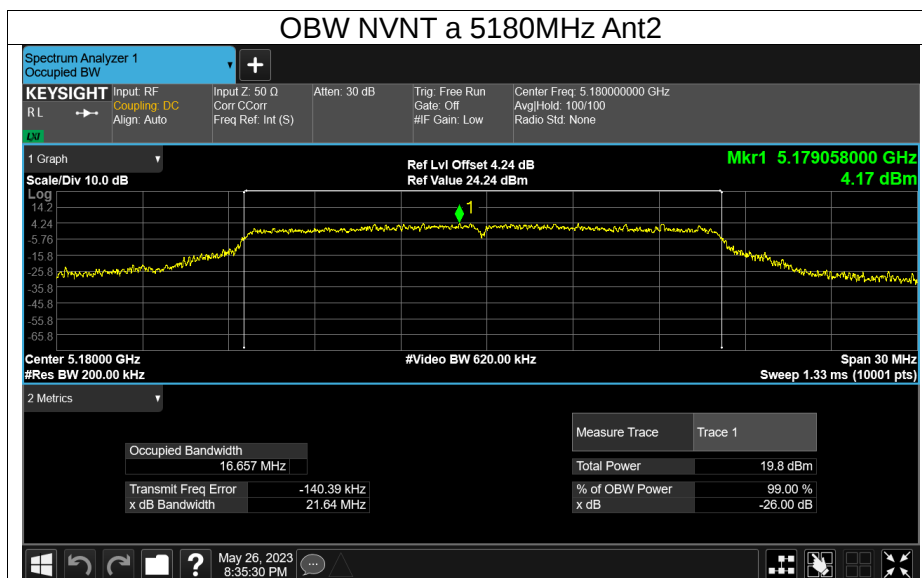

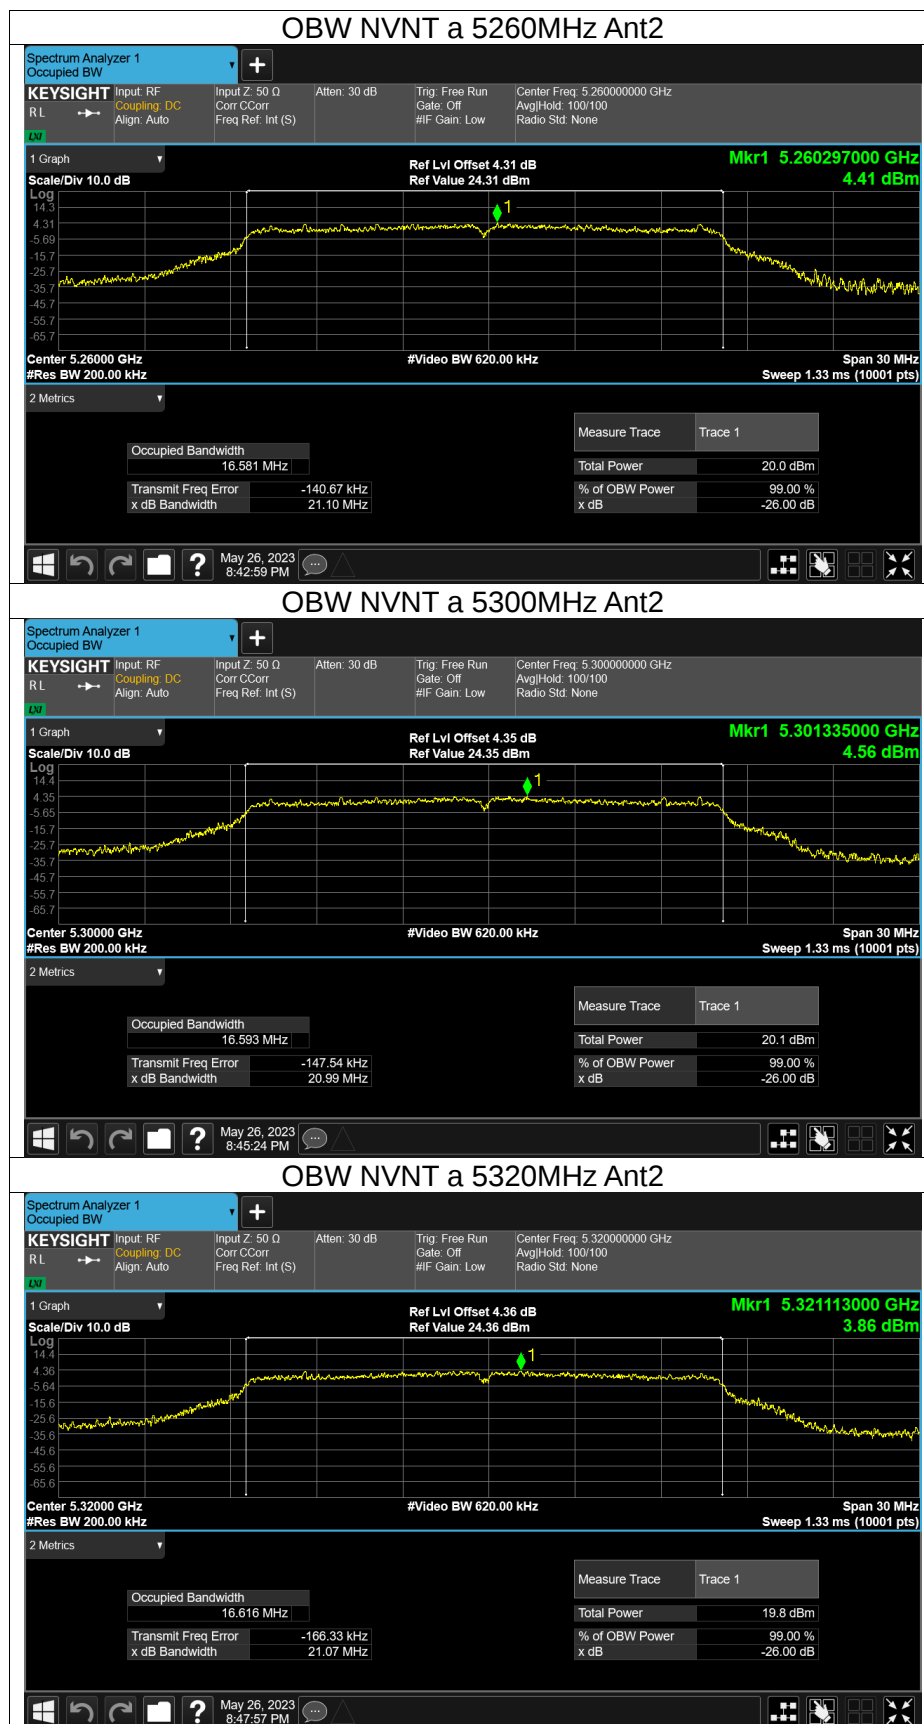

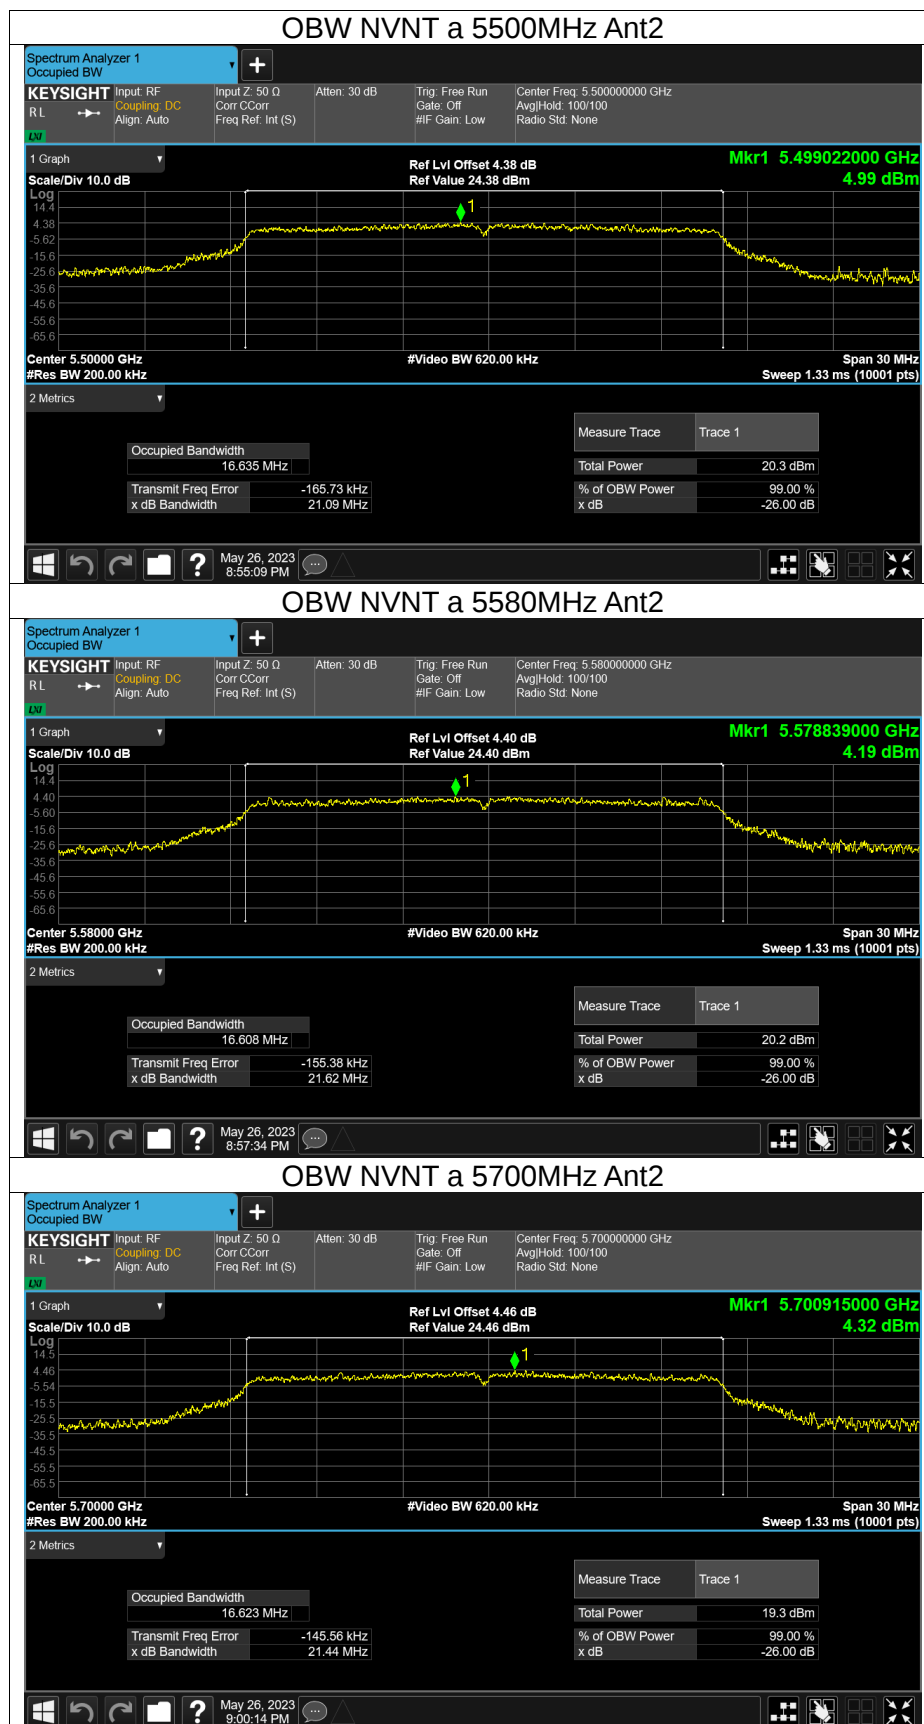


























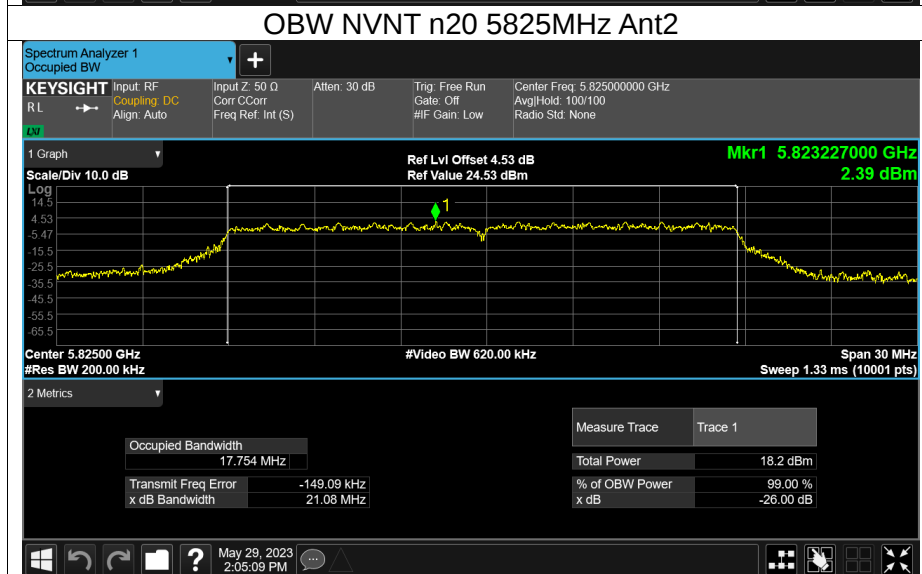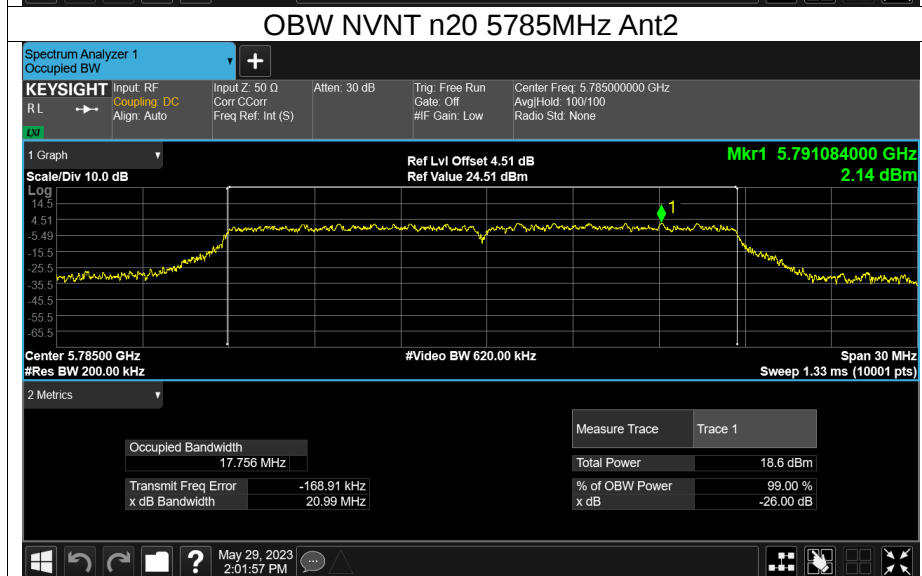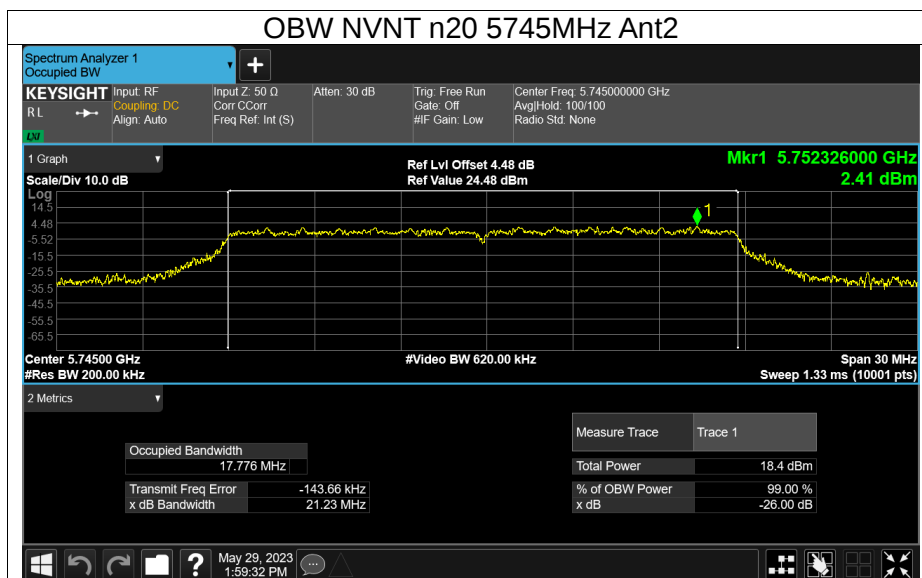




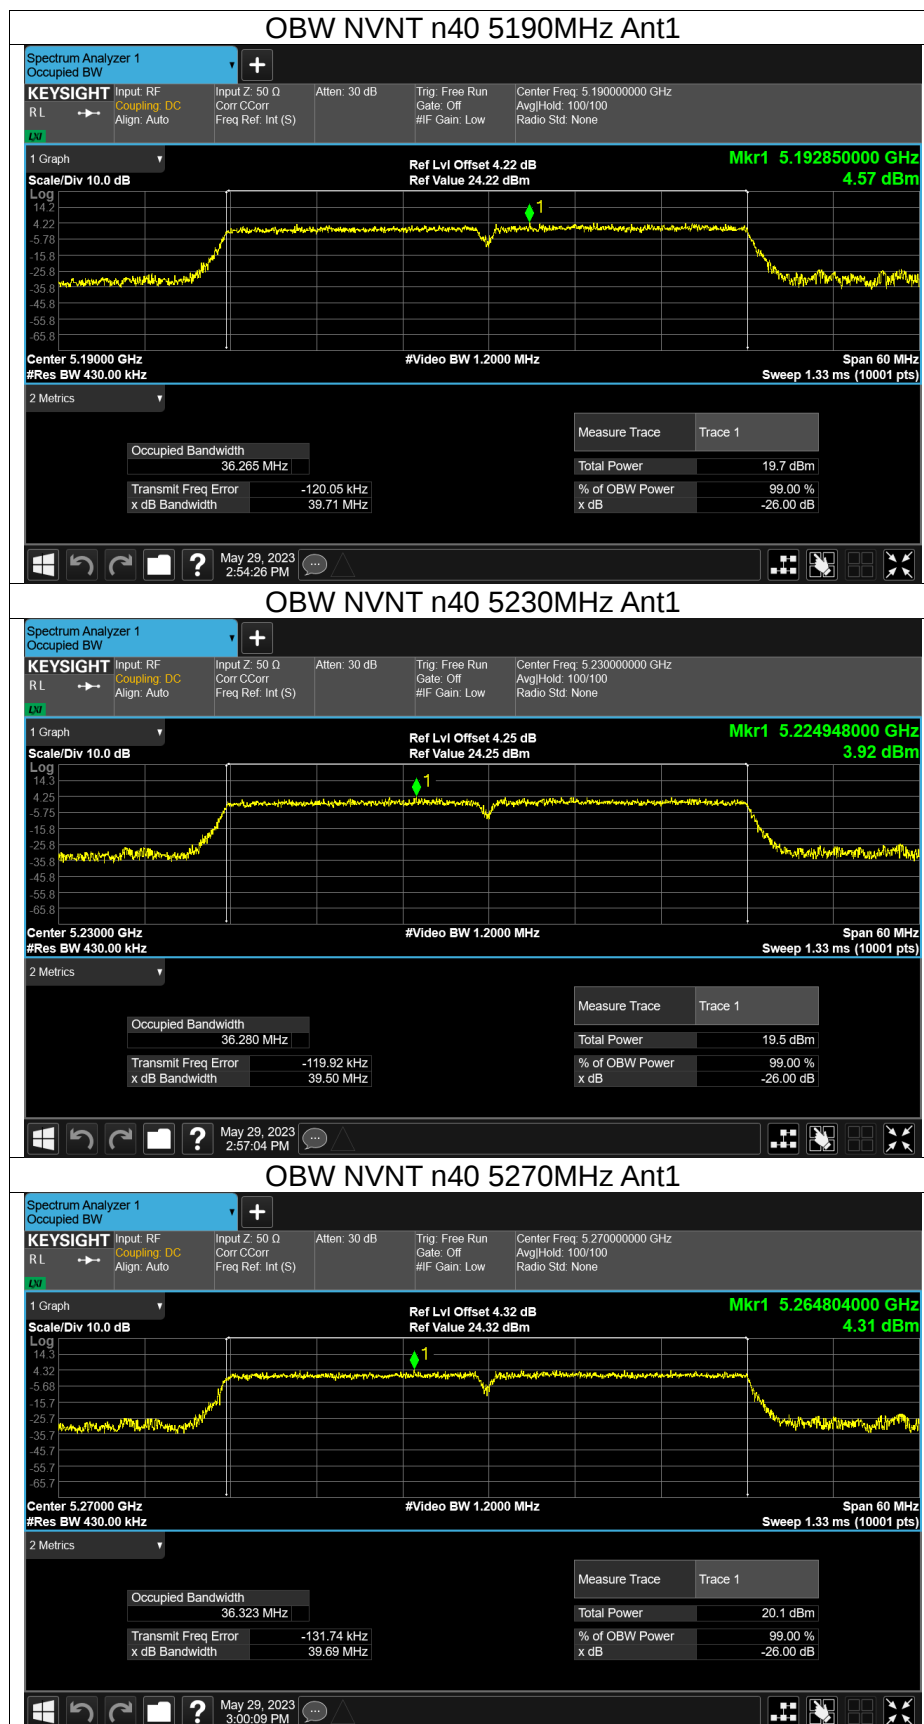


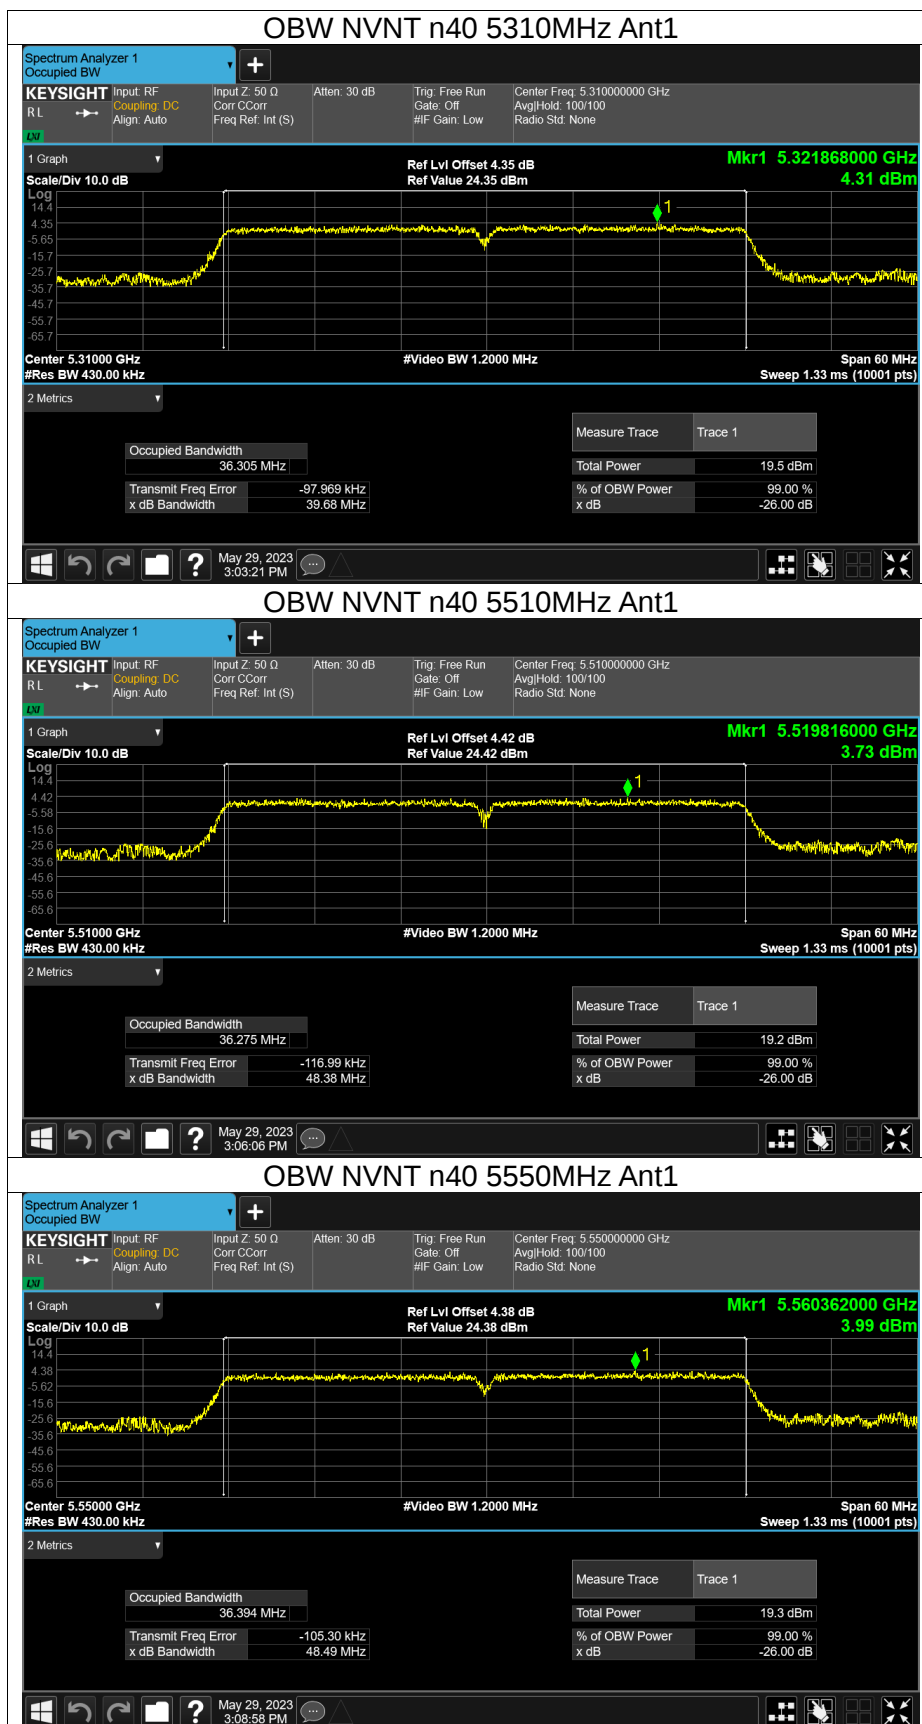


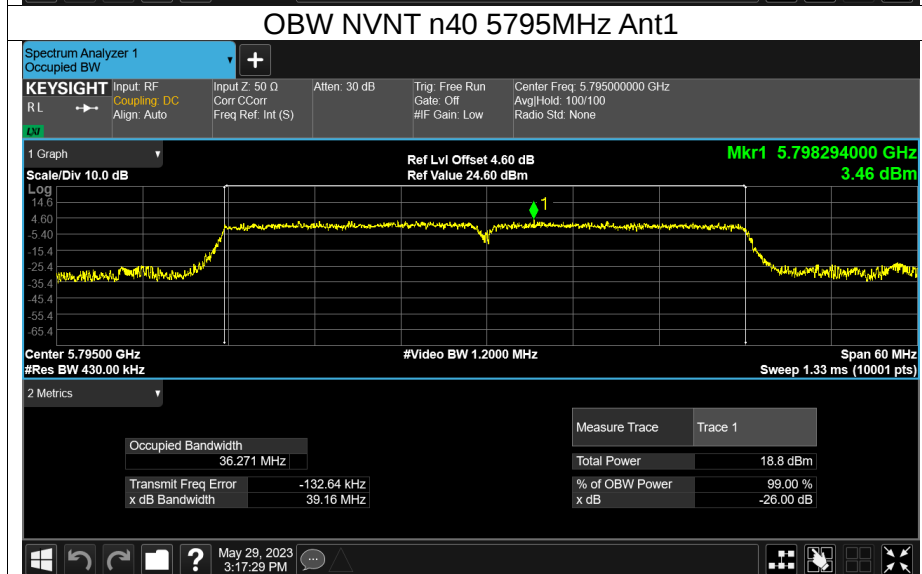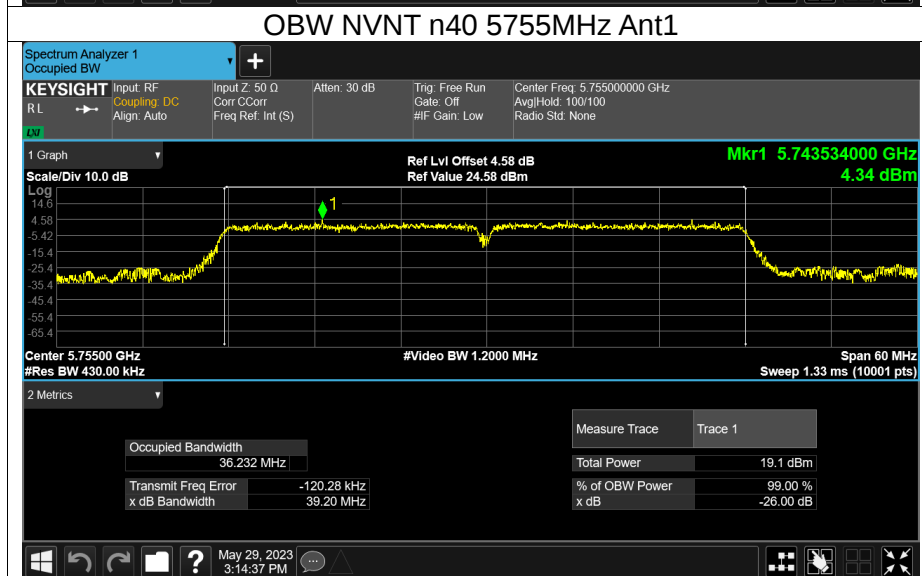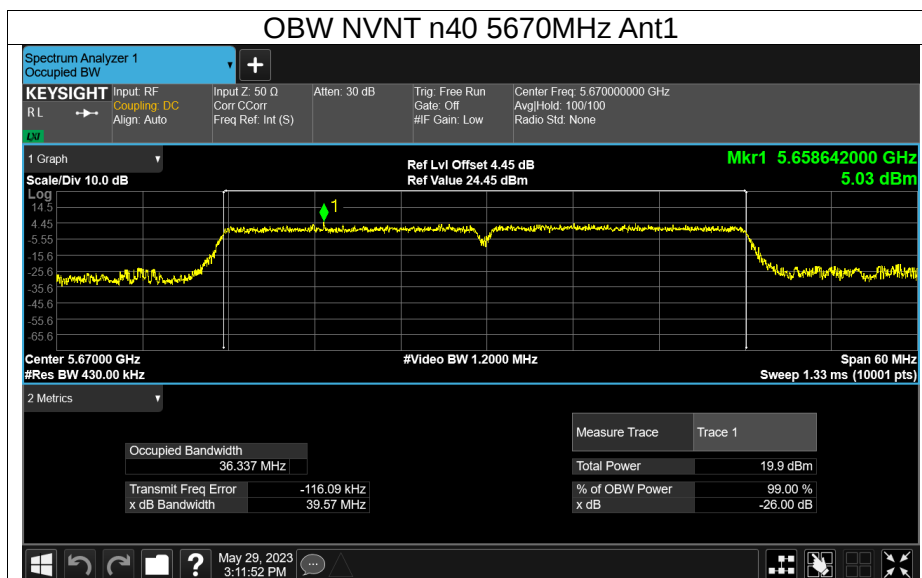


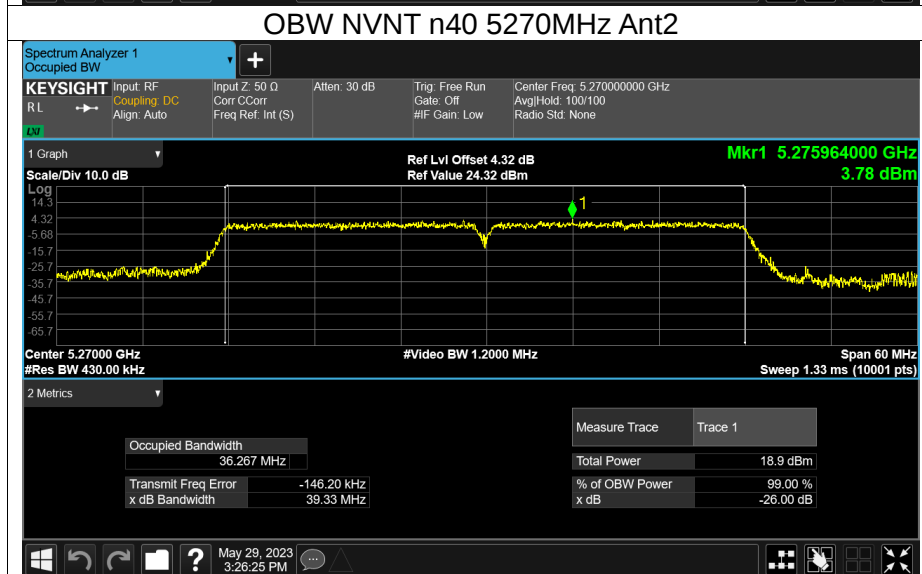
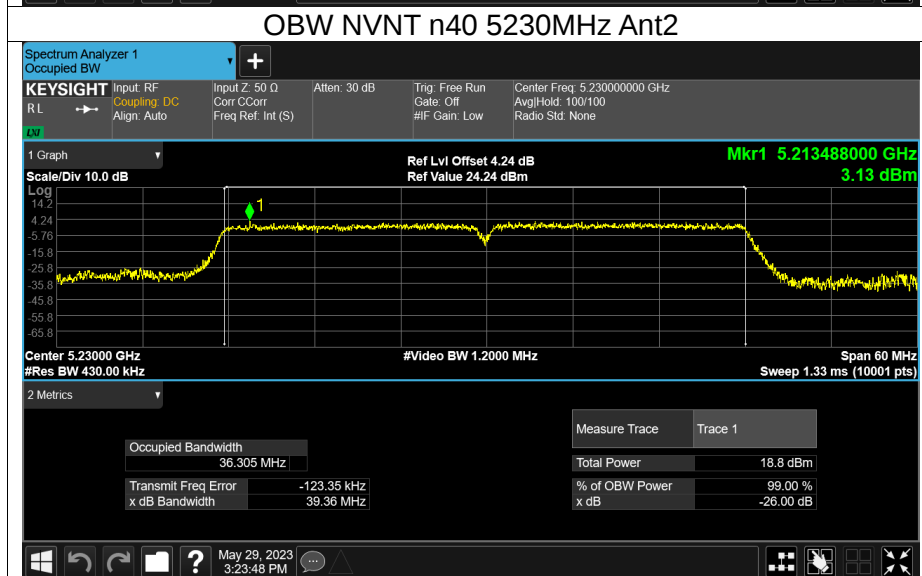
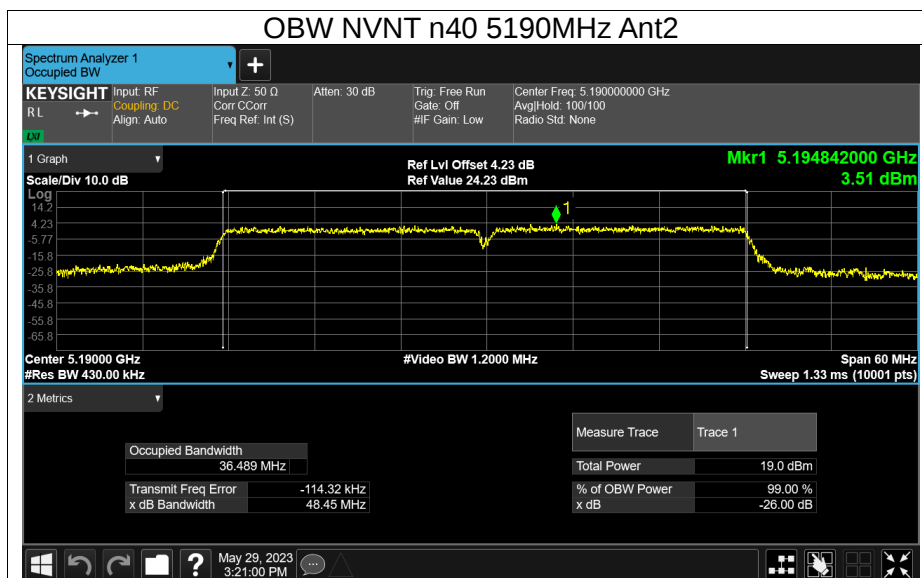


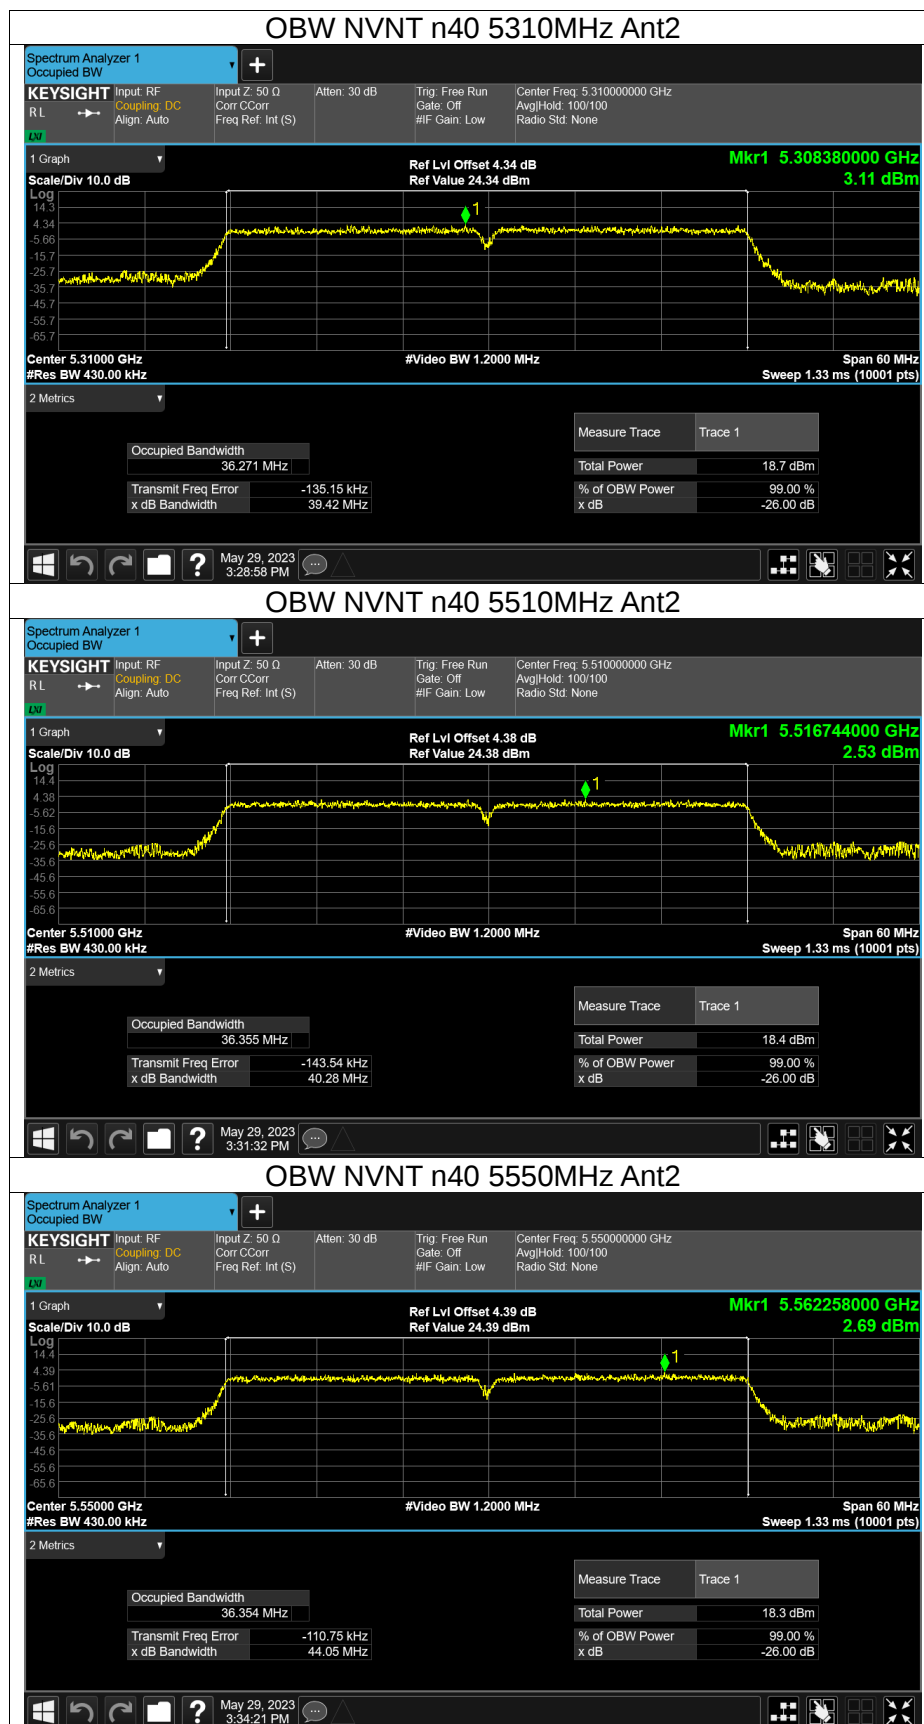


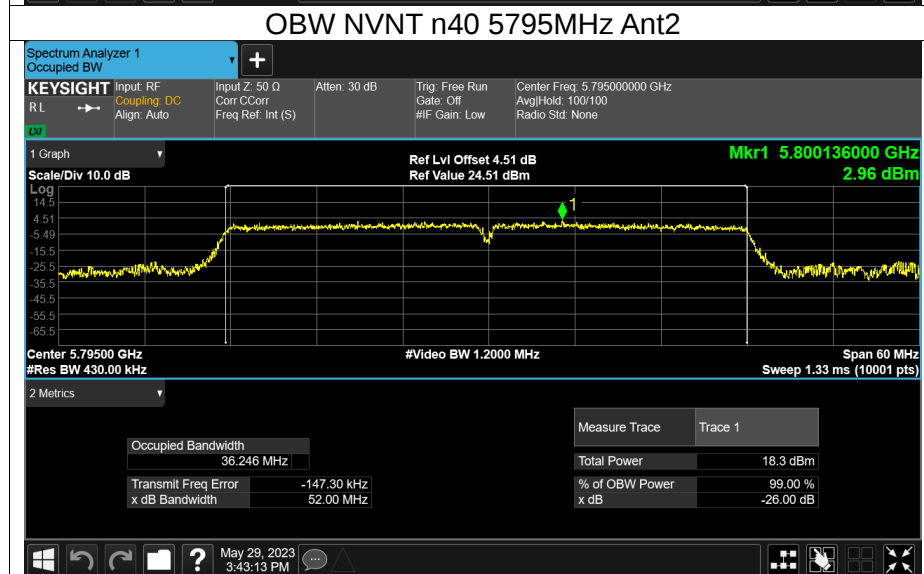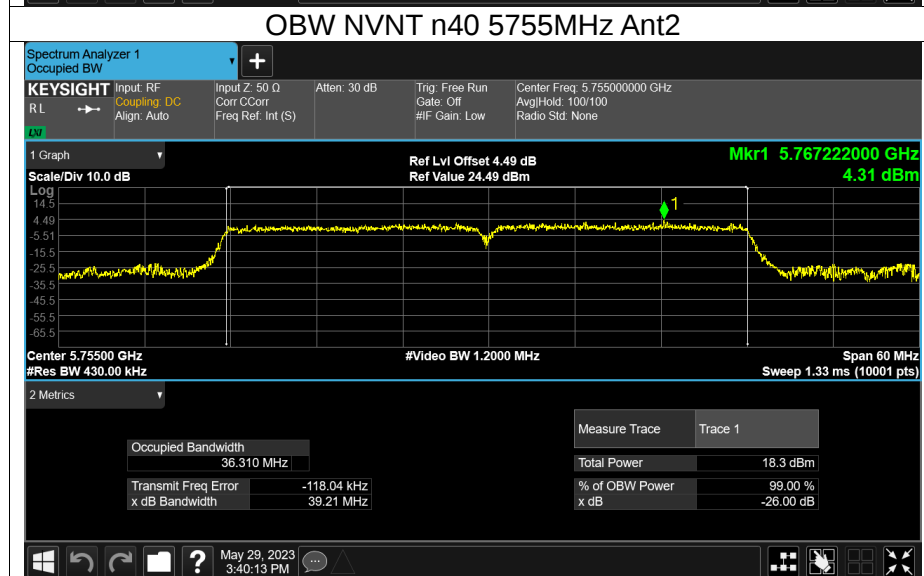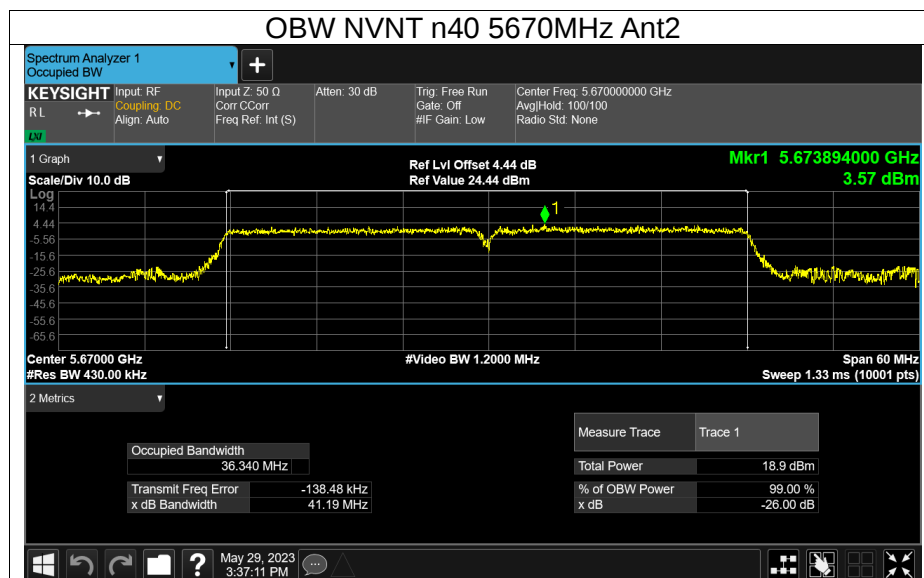

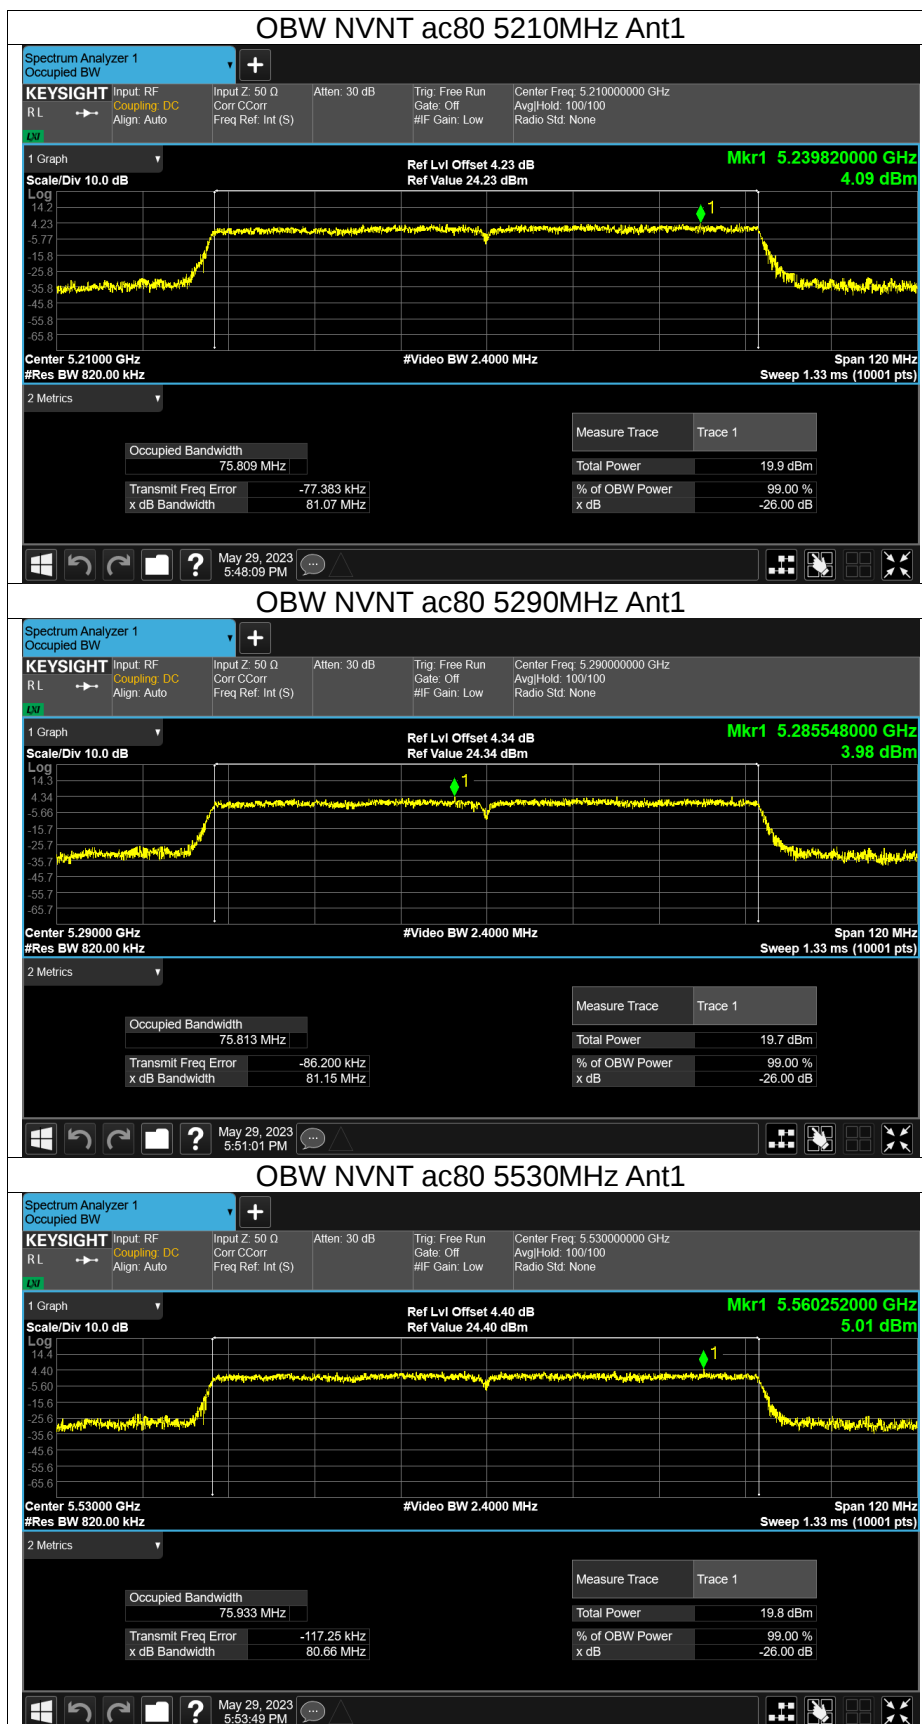

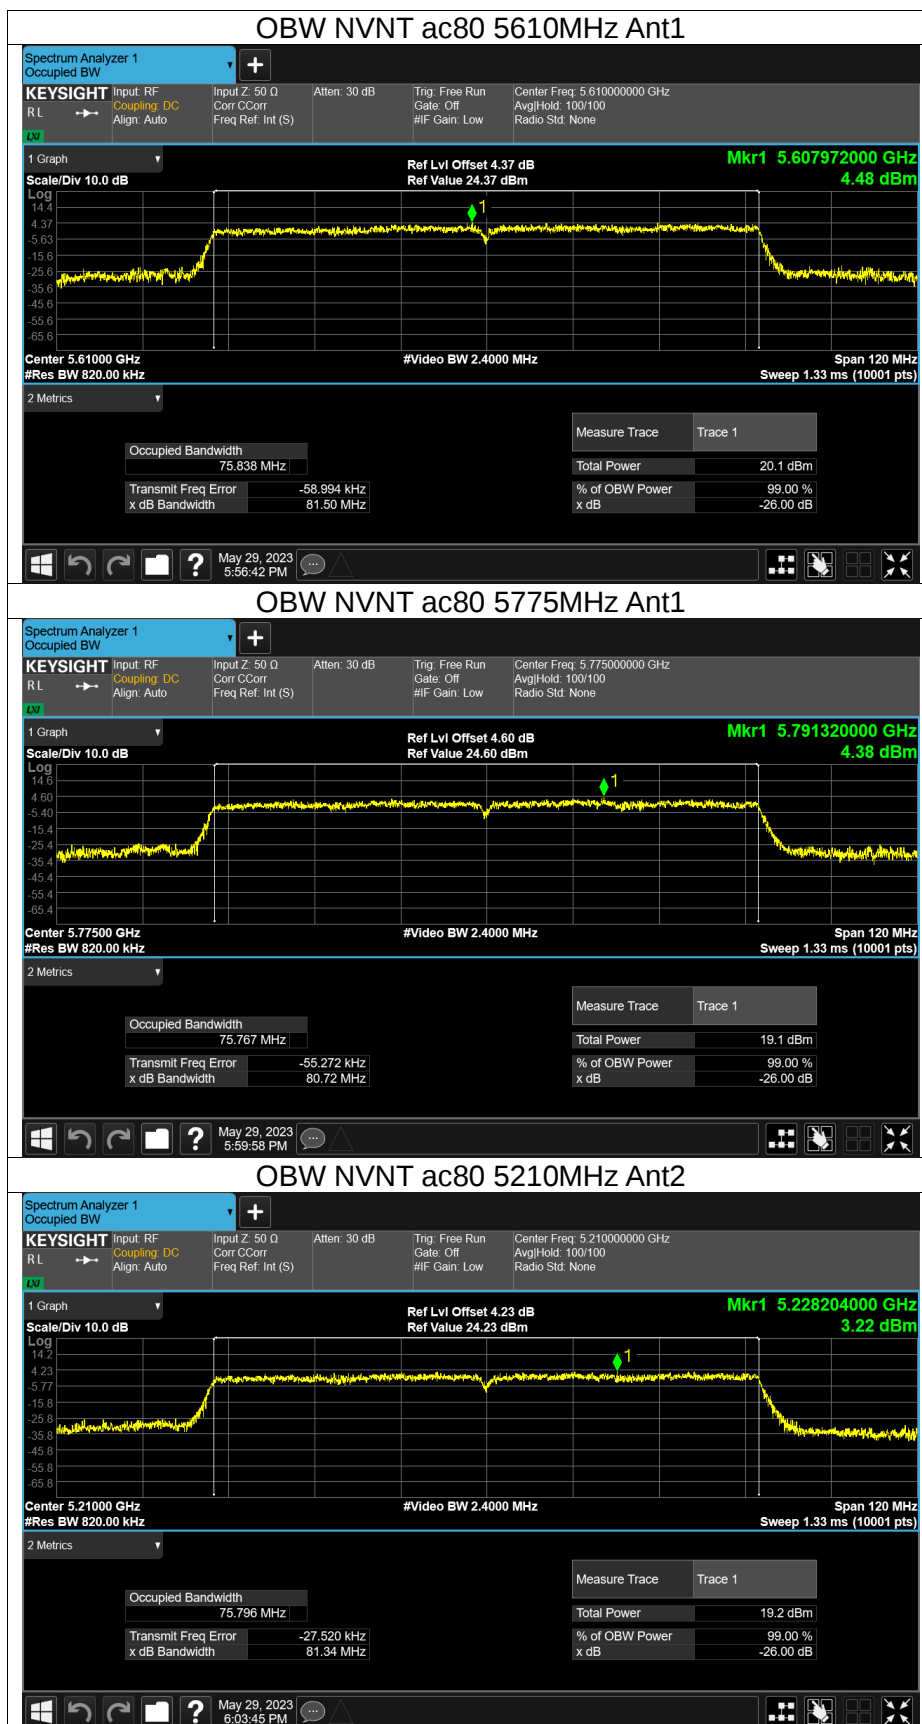

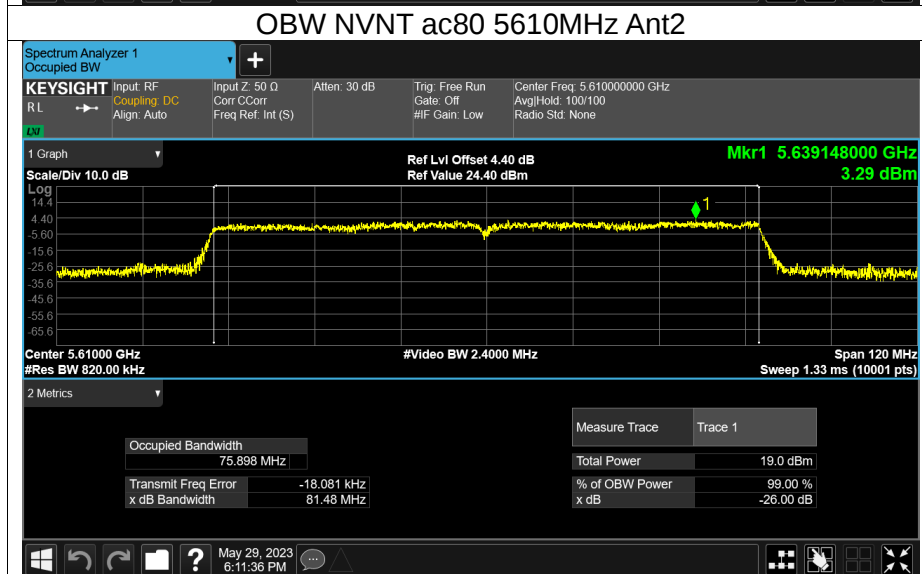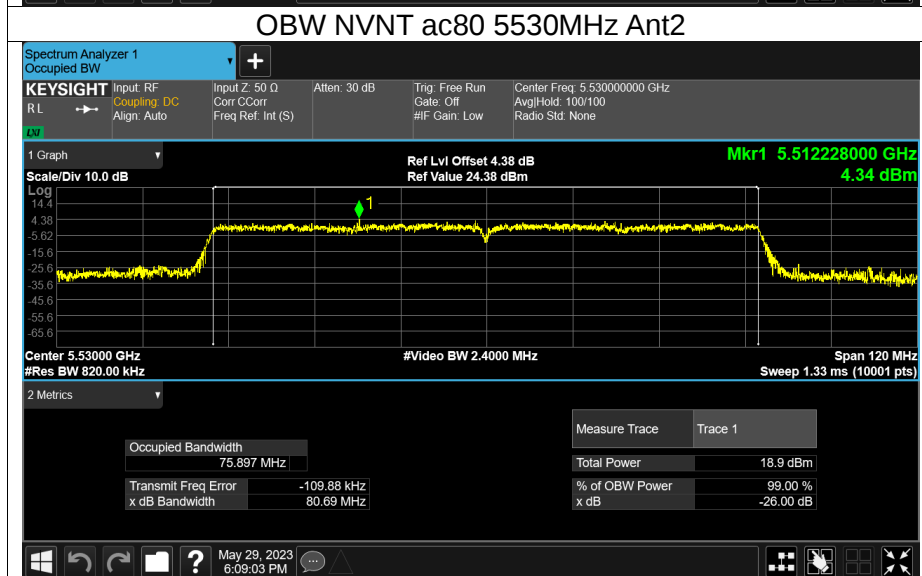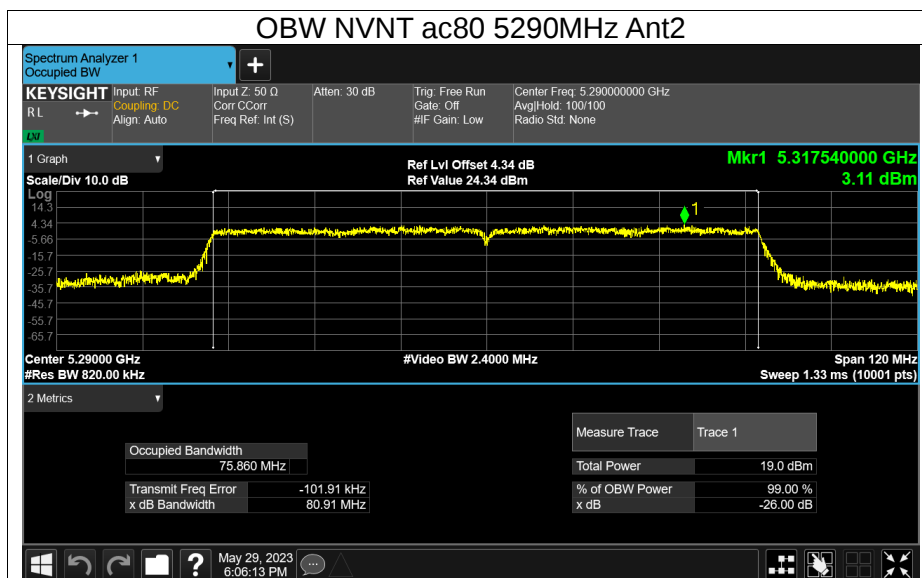

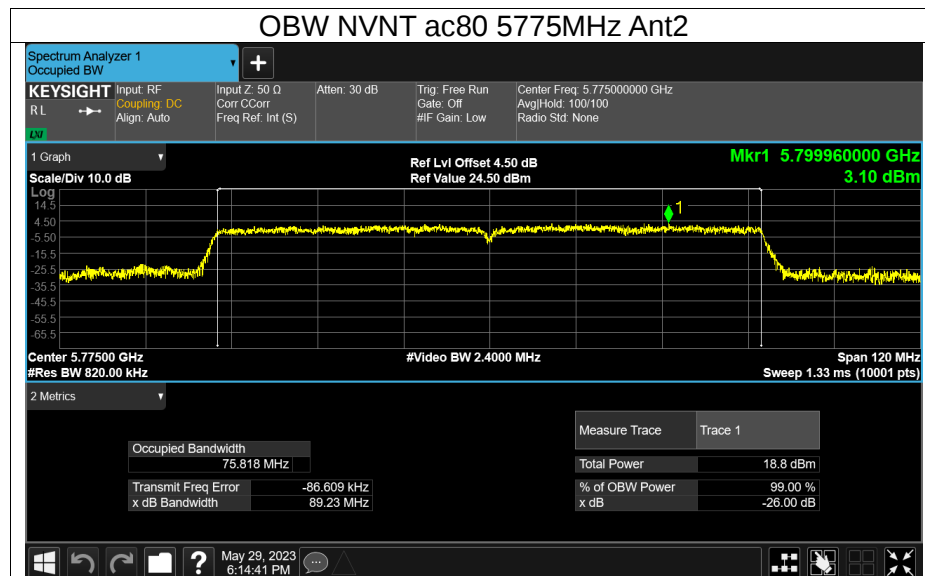



Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	-0.76	0.29	-0.47	11	Pass
NVNT	a	5200	Ant1	-0.58	0.29	-0.29	11	Pass
NVNT	a	5240	Ant1	2.57	0.29	2.86	11	Pass
NVNT	a	5260	Ant1	2.33	0.29	2.62	11	Pass
NVNT	a	5300	Ant1	2.14	0.29	2.43	11	Pass
NVNT	a	5320	Ant1	0.7	0.29	0.99	11	Pass
NVNT	a	5500	Ant1	1.07	0.29	1.36	11	Pass
NVNT	a	5580	Ant1	2.68	0.29	2.97	11	Pass
NVNT	a	5700	Ant1	0.81	0.29	1.1	11	Pass
NVNT	a	5745	Ant1	-3.17	0.29	-2.88	30	Pass
NVNT	a	5785	Ant1	-1.29	0.29	-1	30	Pass
NVNT	a	5825	Ant1	-3.17	0.29	-2.88	30	Pass
NVNT	a	5180	Ant2	1.88	0.29	2.17	11	Pass
NVNT	a	5200	Ant2	0.31	0.29	0.6	11	Pass
NVNT	a	5240	Ant2	1.09	0.29	1.38	11	Pass
NVNT	a	5260	Ant2	2.23	0.29	2.52	11	Pass
NVNT	a	5300	Ant2	0.44	0.29	0.73	11	Pass
NVNT	a	5320	Ant2	-1.64	0.29	-1.35	11	Pass
NVNT	a	5500	Ant2	2.05	0.29	2.34	11	Pass
NVNT	a	5580	Ant2	0.59	0.29	0.88	11	Pass
NVNT	a	5700	Ant2	-0.34	0.29	-0.05	11	Pass
NVNT	a	5745	Ant2	-3.06	0.29	-2.77	30	Pass
NVNT	a	5785	Ant2	-4	0.29	-3.71	30	Pass
NVNT	a	5825	Ant2	-5.2	0.29	-4.91	30	Pass
NVNT	n20	5180	Ant1	-15.67	2	-13.67	11	Pass
NVNT	n20	5200	Ant1	-16.54	2	-14.54	11	Pass
NVNT	n20	5240	Ant1	-16.13	2	-14.13	11	Pass
NVNT	n20	5260	Ant1	-15.09	2	-13.09	11	Pass
NVNT	n20	5300	Ant1	-13.03	2.01	-11.02	11	Pass
NVNT	n20	5320	Ant1	-16.48	2	-14.48	11	Pass
NVNT	n20	5500	Ant1	-16.88	2	-14.88	11	Pass
NVNT	n20	5580	Ant1	-15.66	2	-13.66	11	Pass
NVNT	n20	5700	Ant1	-12.41	2	-10.41	11	Pass
NVNT	n20	5745	Ant1	-17.49	2.02	-15.47	30	Pass
NVNT	n20	5785	Ant1	-19.41	2	-17.41	30	Pass
NVNT	n20	5825	Ant1	-18.64	2	-16.64	30	Pass
NVNT	n20	5180	Ant2	-15.32	2.02	-13.3	11	Pass
NVNT	n20	5200	Ant2	-16.79	2.02	-14.77	11	Pass
NVNT	n20	5240	Ant2	-13.59	2.02	-11.57	11	Pass
NVNT	n20	5260	Ant2	-17.15	2.02	-15.13	11	Pass
NVNT	n20	5300	Ant2	-16.08	2.02	-14.06	11	Pass
NVNT	n20	5320	Ant2	-17.27	2.02	-15.25	11	Pass
NVNT	n20	5500	Ant2	-17.25	2.02	-15.23	11	Pass
NVNT	n20	5580	Ant2	-16.88	2.02	-14.86	11	Pass
NVNT	n20	5700	Ant2	-15.98	2.02	-13.96	11	Pass
NVNT	n20	5745	Ant2	-19.88	2.02	-17.86	30	Pass
NVNT	n20	5785	Ant2	-19.6	2.02	-17.58	30	Pass
NVNT	n20	5825	Ant2	-18.82	2.02	-16.8	30	Pass
NVNT	n20	5180	Ant1	-10.32	2.02	-8.3	11	Pass
NVNT	n20	5180	Ant2	-36.51	2.02	-34.49	11	Pass



NVNT	n20	5180	Sum	-10.31	2.02	-8.29	11	Pass
NVNT	n20	5200	Ant1	-13.9	2.02	-11.88	11	Pass
NVNT	n20	5200	Ant2	-33.33	2.02	-31.31	11	Pass
NVNT	n20	5200	Sum	-13.85	2.02	-11.83	11	Pass
NVNT	n20	5240	Ant1	-17.59	2.02	-15.57	11	Pass
NVNT	n20	5240	Ant2	-31.63	2.02	-29.61	11	Pass
NVNT	n20	5240	Sum	-17.42	2.02	-15.4	11	Pass
NVNT	n20	5260	Ant1	-16	2.01	-13.99	11	Pass
NVNT	n20	5260	Ant2	-33.69	2.01	-31.68	11	Pass
NVNT	n20	5260	Sum	-15.93	2.01	-13.92	11	Pass
NVNT	n20	5300	Ant1	-13.53	2.01	-11.52	11	Pass
NVNT	n20	5300	Ant2	-35.46	2.01	-33.45	11	Pass
NVNT	n20	5300	Sum	-13.5	2.01	-11.49	11	Pass
NVNT	n20	5320	Ant1	-15.97	2.01	-13.96	11	Pass
NVNT	n20	5320	Ant2	-36.01	2.01	-34	11	Pass
NVNT	n20	5320	Sum	-15.93	2.01	-13.92	11	Pass
NVNT	n20	5500	Ant1	-14.72	2.01	-12.71	11	Pass
NVNT	n20	5500	Ant2	-32.35	2.01	-30.34	11	Pass
NVNT	n20	5500	Sum	-14.65	2.01	-12.64	11	Pass
NVNT	n20	5580	Ant1	-16.85	2.02	-14.83	11	Pass
NVNT	n20	5580	Ant2	-37.45	2.02	-35.43	11	Pass
NVNT	n20	5580	Sum	-16.81	2.02	-14.79	11	Pass
NVNT	n20	5700	Ant1	-13.45	2.01	-11.44	11	Pass
NVNT	n20	5700	Ant2	-35.78	2.01	-33.77	11	Pass
NVNT	n20	5700	Sum	-13.42	2.01	-11.41	11	Pass
NVNT	n20	5745	Ant1	-20.13	2.02	-18.11	30	Pass
NVNT	n20	5745	Ant2	-39	2.02	-36.98	30	Pass
NVNT	n20	5745	Sum	-20.07	2.02	-18.05	30	Pass
NVNT	n20	5785	Ant1	-17.08	2.01	-15.07	30	Pass
NVNT	n20	5785	Ant2	-38.79	2.01	-36.78	30	Pass
NVNT	n20	5785	Sum	-17.05	2.01	-15.04	30	Pass
NVNT	n20	5825	Ant1	-19.33	2.01	-17.32	30	Pass
NVNT	n20	5825	Ant2	-39.1	2.01	-37.09	30	Pass
NVNT	n20	5825	Sum	-19.28	2.01	-17.27	30	Pass
NVNT	n40	5190	Ant1	-25.38	2.88	-22.5	11	Pass
NVNT	n40	5230	Ant1	-26.08	2.88	-23.2	11	Pass
NVNT	n40	5270	Ant1	-25.08	2.88	-22.2	11	Pass
NVNT	n40	5310	Ant1	-25.81	2.86	-22.95	11	Pass
NVNT	n40	5510	Ant1	-21.35	2.88	-18.47	11	Pass
NVNT	n40	5550	Ant1	-23.77	2.86	-20.91	11	Pass
NVNT	n40	5670	Ant1	-23.92	2.86	-21.06	11	Pass
NVNT	n40	5755	Ant1	-26.27	2.86	-23.41	30	Pass
NVNT	n40	5795	Ant1	-25.84	2.87	-22.97	30	Pass
NVNT	n40	5190	Ant2	-24.09	2.88	-21.21	11	Pass
NVNT	n40	5230	Ant2	-26.48	2.88	-23.6	11	Pass
NVNT	n40	5270	Ant2	-21.04	2.87	-18.17	11	Pass
NVNT	n40	5310	Ant2	-21.85	2.87	-18.98	11	Pass
NVNT	n40	5510	Ant2	-25.24	2.88	-22.36	11	Pass
NVNT	n40	5550	Ant2	-23.1	2.88	-20.22	11	Pass
NVNT	n40	5670	Ant2	-25.23	2.88	-22.35	11	Pass
NVNT	n40	5755	Ant2	-28.15	2.88	-25.27	30	Pass
NVNT	n40	5795	Ant2	-27.19	2.89	-24.3	30	Pass
NVNT	n40	5190	Ant1	-19.64	2.87	-16.77	11	Pass
NVNT	n40	5190	Ant2	-38.75	2.87	-35.88	11	Pass
NVNT	n40	5190	Sum	-19.59	2.87	-16.72	11	Pass



NVNT	n40	5230	Ant1	-23.41	2.86	-20.55	11	Pass
NVNT	n40	5230	Ant2	-36.86	2.86	-34	11	Pass
NVNT	n40	5230	Sum	-23.22	2.86	-20.36	11	Pass
NVNT	n40	5270	Ant1	-23.75	2.86	-20.89	11	Pass
NVNT	n40	5270	Ant2	-37.28	2.86	-34.42	11	Pass
NVNT	n40	5270	Sum	-23.56	2.86	-20.7	11	Pass
NVNT	n40	5310	Ant1	-23.53	2.86	-20.67	11	Pass
NVNT	n40	5310	Ant2	-38.08	2.86	-35.22	11	Pass
NVNT	n40	5310	Sum	-23.38	2.86	-20.52	11	Pass
NVNT	n40	5510	Ant1	-25.8	2.88	-22.92	11	Pass
NVNT	n40	5510	Ant2	-37.56	2.88	-34.68	11	Pass
NVNT	n40	5510	Sum	-25.52	2.88	-22.64	11	Pass
NVNT	n40	5550	Ant1	-23.61	2.87	-20.74	11	Pass
NVNT	n40	5550	Ant2	-39.64	2.87	-36.77	11	Pass
NVNT	n40	5550	Sum	-23.5	2.87	-20.63	11	Pass
NVNT	n40	5670	Ant1	-23.76	2.87	-20.89	11	Pass
NVNT	n40	5670	Ant2	-37.47	2.87	-34.6	11	Pass
NVNT	n40	5670	Sum	-23.58	2.87	-20.71	11	Pass
NVNT	n40	5755	Ant1	-26.38	2.88	-23.5	30	Pass
NVNT	n40	5755	Ant2	-40.99	2.88	-38.11	30	Pass
NVNT	n40	5755	Sum	-26.23	2.88	-23.35	30	Pass
NVNT	n40	5795	Ant1	-27.17	2.86	-24.31	30	Pass
NVNT	n40	5795	Ant2	-42.69	2.86	-39.83	30	Pass
NVNT	n40	5795	Sum	-27.05	2.86	-24.19	30	Pass
NVNT	ac80	5210	Ant1	-32.22	3.87	-28.35	11	Pass
NVNT	ac80	5290	Ant1	-29.13	3.87	-25.26	11	Pass
NVNT	ac80	5530	Ant1	-32.19	3.87	-28.32	11	Pass
NVNT	ac80	5610	Ant1	-31.91	3.87	-28.04	11	Pass
NVNT	ac80	5775	Ant1	-31.6	3.86	-27.74	30	Pass
NVNT	ac80	5210	Ant2	-30.55	3.87	-26.68	11	Pass
NVNT	ac80	5290	Ant2	-30.84	3.86	-26.98	11	Pass
NVNT	ac80	5530	Ant2	-33.55	3.89	-29.66	11	Pass
NVNT	ac80	5610	Ant2	-29.98	3.89	-26.09	11	Pass
NVNT	ac80	5775	Ant2	-32.6	3.87	-28.73	30	Pass
NVNT	ac80	5210	Ant1	-30.22	3.87	-26.35	11	Pass
NVNT	ac80	5210	Ant2	-40.81	3.87	-36.94	11	Pass
NVNT	ac80	5210	Sum	-29.86	3.87	-25.99	11	Pass
NVNT	ac80	5290	Ant1	-31.84	3.87	-27.97	11	Pass
NVNT	ac80	5290	Ant2	-40.11	3.87	-36.24	11	Pass
NVNT	ac80	5290	Sum	-31.24	3.87	-27.37	11	Pass
NVNT	ac80	5530	Ant1	-26.94	3.87	-23.07	11	Pass
NVNT	ac80	5530	Ant2	-39.97	3.87	-36.1	11	Pass
NVNT	ac80	5530	Sum	-26.73	3.87	-22.86	11	Pass
NVNT	ac80	5610	Ant1	-30.04	3.86	-26.18	11	Pass
NVNT	ac80	5610	Ant2	-40.26	3.86	-36.4	11	Pass
NVNT	ac80	5610	Sum	-29.65	3.86	-25.79	11	Pass
NVNT	ac80	5775	Ant1	-29.5	3.87	-25.63	30	Pass
NVNT	ac80	5775	Ant2	-39.92	3.87	-36.05	30	Pass
NVNT	ac80	5775	Sum	-29.12	3.87	-25.25	30	Pass



