





Band2-5MHz-QPSK-18625-1RB#24

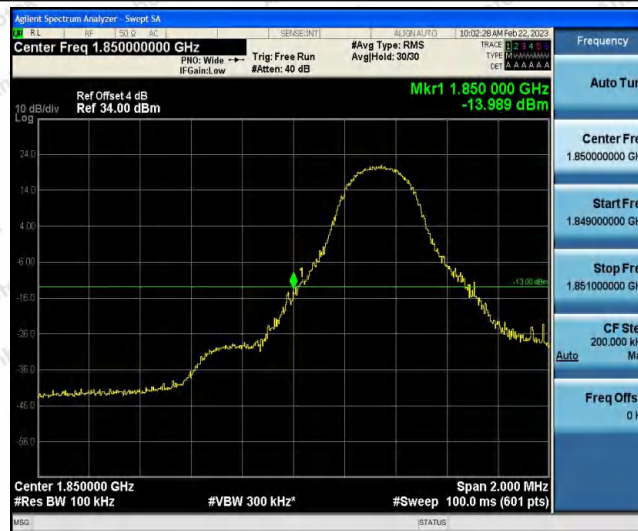

Band2-5MHz-QPSK-18625-25RB#0

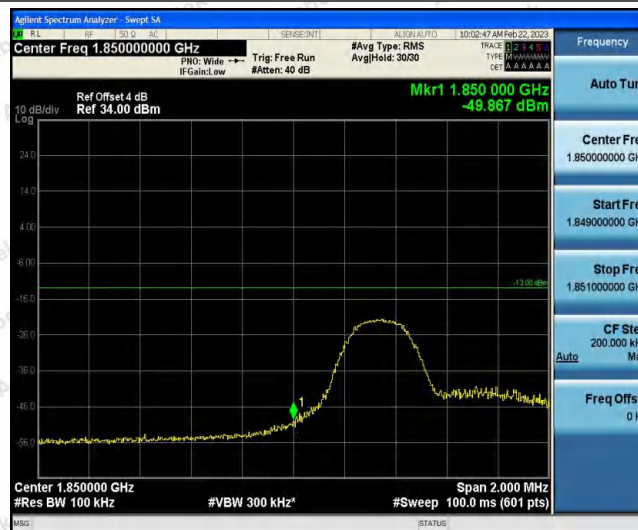

Band2-5MHz-QPSK-19175-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-QPSK-19175-1RB#24



Band2-5MHz-QPSK-19175-25RB#0



Band2-5MHz-16QAM-18625-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-5MHz-16QAM-18625-1RB#24



Band2-5MHz-16QAM-18625-25RB#0



Band2-5MHz-16QAM-19175-1RB#0


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



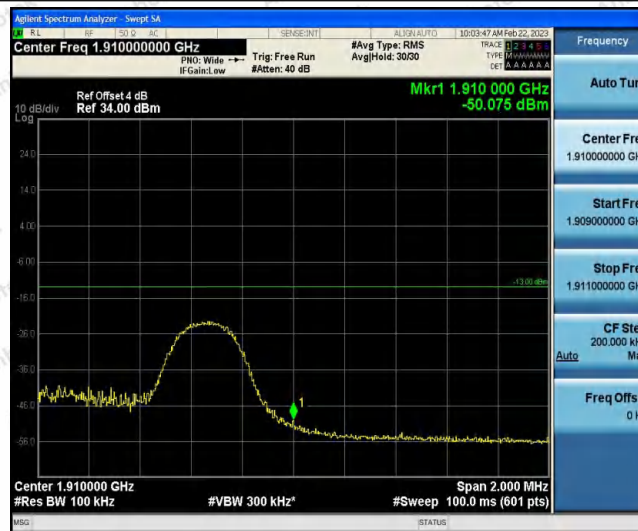

Band2-5MHz-16QAM-19175-1RB#24

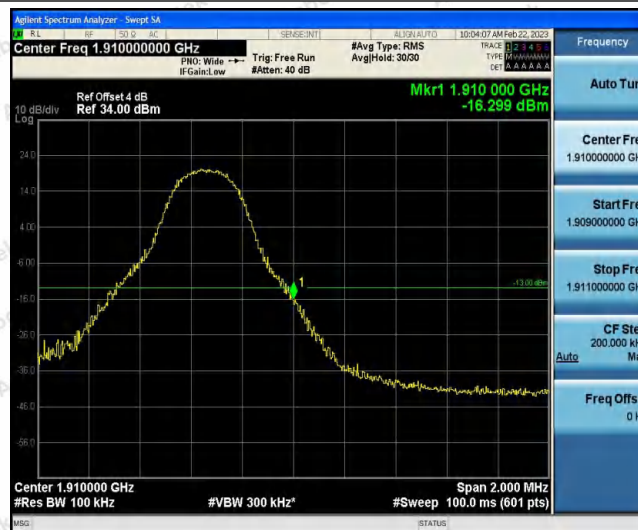

Band2-5MHz-16QAM-19175-25RB#0



Band2-10MHz-QPSK-18650-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-QPSK-18650-1RB#49



Band2-10MHz-QPSK-18650-50RB#0



Band2-10MHz-QPSK-19150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-QPSK-19150-1RB#49



Band2-10MHz-QPSK-19150-50RB#0



Band2-10MHz-16QAM-18650-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-16QAM-18650-1RB#49



Band2-10MHz-16QAM-18650-50RB#0



Band2-10MHz-16QAM-19150-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-10MHz-16QAM-19150-1RB#49



Band2-10MHz-16QAM-19150-50RB#0



Band2-15MHz-QPSK-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-QPSK-18675-1RB#74



Band2-15MHz-QPSK-18675-75RB#0



Band2-15MHz-QPSK-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-QPSK-19125-1RB#74



Band2-15MHz-QPSK-19125-75RB#0



Band2-15MHz-16QAM-18675-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-16QAM-18675-1RB#74



Band2-15MHz-16QAM-18675-75RB#0



Band2-15MHz-16QAM-19125-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-15MHz-16QAM-19125-1RB#74



Band2-15MHz-16QAM-19125-75RB#0



Band2-20MHz-QPSK-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-QPSK-18700-1RB#99



Band2-20MHz-QPSK-18700-100RB#0



Band2-20MHz-QPSK-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-QPSK-19100-1RB#99



Band2-20MHz-QPSK-19100-100RB#0



Band2-20MHz-16QAM-18700-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-16QAM-18700-1RB#99



Band2-20MHz-16QAM-18700-100RB#0



Band2-20MHz-16QAM-19100-1RB#0

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn





Band2-20MHz-16QAM-19100-1RB#99



Band2-20MHz-16QAM-19100-100RB#0



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band2	1.4MHz	QPSK	18607	1RB#0	Range1:30~1000MHz	-57.02	PASS
Band2	1.4MHz	QPSK	18607	1RB#0	Range2:1000~20000MHz	-32.81	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.51	PASS
Band2	1.4MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.45	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range1:30~1000MHz	-57.07	PASS
Band2	1.4MHz	QPSK	19193	1RB#0	Range2:1000~20000MHz	-33.72	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range1:30~1000MHz	-56.74	PASS
Band2	1.4MHz	16QAM	18607	1RB#0	Range2:1000~20000MHz	-32.9	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.65	PASS
Band2	1.4MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.5	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range1:30~1000MHz	-57.77	PASS
Band2	1.4MHz	16QAM	19193	1RB#0	Range2:1000~20000MHz	-33.44	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range1:30~1000MHz	-57.5	PASS
Band2	3MHz	QPSK	18615	1RB#0	Range2:1000~20000MHz	-32.78	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.06	PASS
Band2	3MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.26	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range1:30~1000MHz	-57.48	PASS
Band2	3MHz	QPSK	19185	1RB#0	Range2:1000~20000MHz	-33.63	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	18615	1RB#0	Range1:30~1000MHz	-57	PASS
Band2	3MHz	16QAM	18615	1RB#0	Range2:1000~20000MHz	-31.76	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.74	PASS
Band2	3MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.43	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range1:30~1000MHz	-56.96	PASS
Band2	3MHz	16QAM	19185	1RB#0	Range2:1000~20000MHz	-31.46	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range1:30~1000MHz	-57.3	PASS
Band2	5MHz	QPSK	18625	1RB#0	Range2:1000~20000MHz	-33.66	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.25	PASS
Band2	5MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.93	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range1:30~1000MHz	-56.57	PASS
Band2	5MHz	QPSK	19175	1RB#0	Range2:1000~20000MHz	-33.02	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range1:30~1000MHz	-56.43	PASS
Band2	5MHz	16QAM	18625	1RB#0	Range2:1000~20000MHz	-33.38	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.27	PASS
Band2	5MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-32.97	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range1:30~1000MHz	-56.74	PASS
Band2	5MHz	16QAM	19175	1RB#0	Range2:1000~20000MHz	-33.66	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range1:30~1000MHz	-56.93	PASS
Band2	10MHz	QPSK	18650	1RB#0	Range2:1000~20000MHz	-33.8	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-57.12	PASS
Band2	10MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-28.53	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	10MHz	QPSK	19150	1RB#0	Range1:30~1000MHz	-56.45	PASS
Band2	10MHz	QPSK	19150	1RB#0	Range2:1000~20000MHz	-33.64	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range1:30~1000MHz	-56.82	PASS
Band2	10MHz	16QAM	18650	1RB#0	Range2:1000~20000MHz	-29.7	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.19	PASS
Band2	10MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.63	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range1:30~1000MHz	-57.53	PASS
Band2	10MHz	16QAM	19150	1RB#0	Range2:1000~20000MHz	-32.73	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range1:30~1000MHz	-57.11	PASS
Band2	15MHz	QPSK	18675	1RB#0	Range2:1000~20000MHz	-33.73	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-56.8	PASS
Band2	15MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-33.22	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range1:30~1000MHz	-57.24	PASS
Band2	15MHz	QPSK	19125	1RB#0	Range2:1000~20000MHz	-33.11	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range1:30~1000MHz	-57.13	PASS
Band2	15MHz	16QAM	18675	1RB#0	Range2:1000~20000MHz	-33.31	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-57.22	PASS
Band2	15MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-31.15	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range1:30~1000MHz	-56.43	PASS
Band2	15MHz	16QAM	19125	1RB#0	Range2:1000~20000MHz	-32.91	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range1:30~1000MHz	-57.7	PASS
Band2	20MHz	QPSK	18700	1RB#0	Range2:1000~20000MHz	-33.57	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn



Band2	20MHz	QPSK	18900	1RB#0	Range1:30~1000MHz	-56.66	PASS
Band2	20MHz	QPSK	18900	1RB#0	Range2:1000~20000MHz	-32.82	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range1:30~1000MHz	-57.24	PASS
Band2	20MHz	QPSK	19100	1RB#0	Range2:1000~20000MHz	-33.45	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range1:30~1000MHz	-57.53	PASS
Band2	20MHz	16QAM	18700	1RB#0	Range2:1000~20000MHz	-33.18	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range1:30~1000MHz	-56.92	PASS
Band2	20MHz	16QAM	18900	1RB#0	Range2:1000~20000MHz	-33.01	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range1:30~1000MHz	-57.08	PASS
Band2	20MHz	16QAM	19100	1RB#0	Range2:1000~20000MHz	-32.99	PASS

Test Graphs

Band2-1.4MHz-QPSK-18607-1RB#0-Range1:30~1000MHz

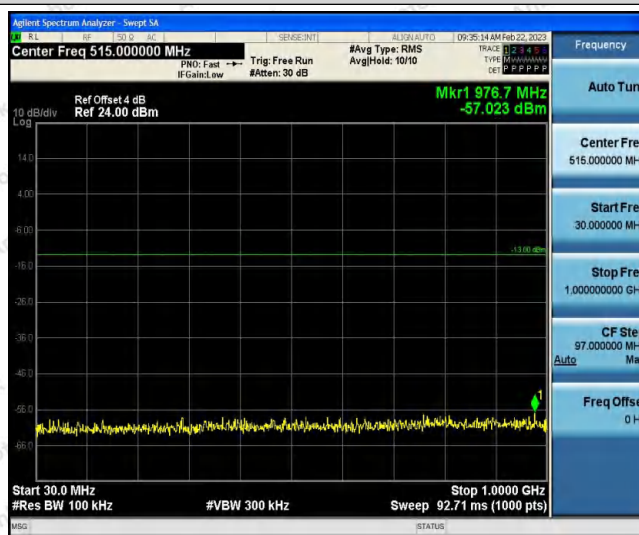

Band2-1.4MHz-QPSK-18607-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




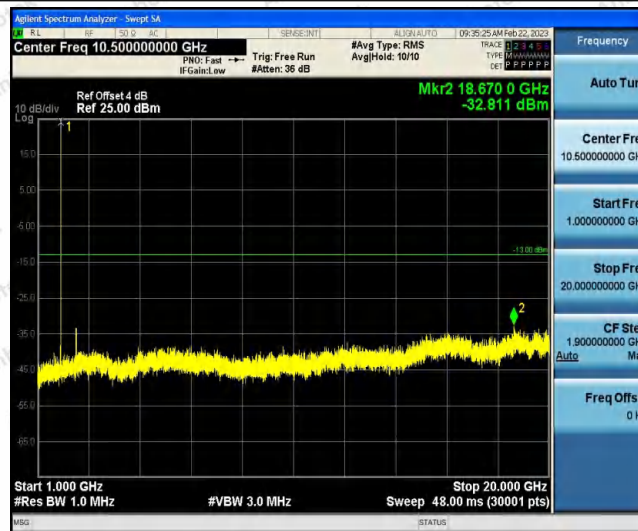

Band2-1.4MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

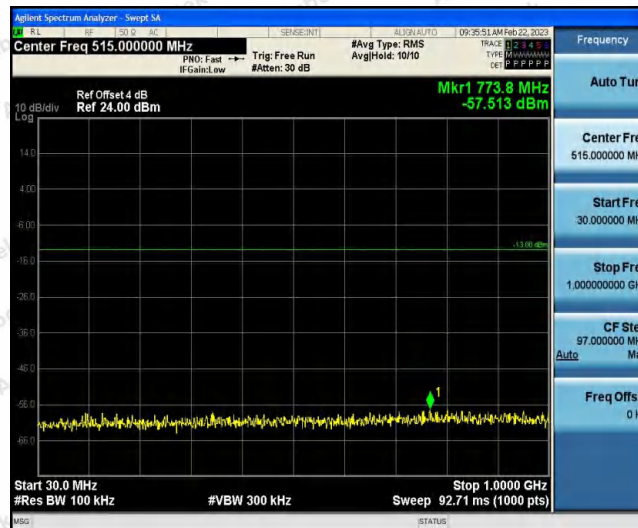

Band2-1.4MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

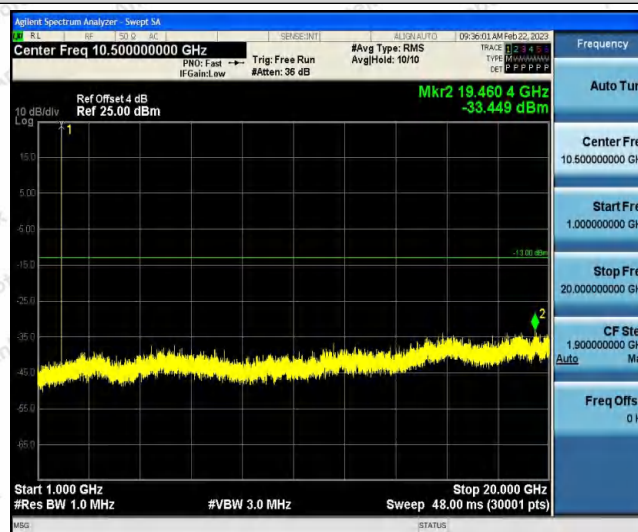

Band2-1.4MHz-QPSK-19193-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




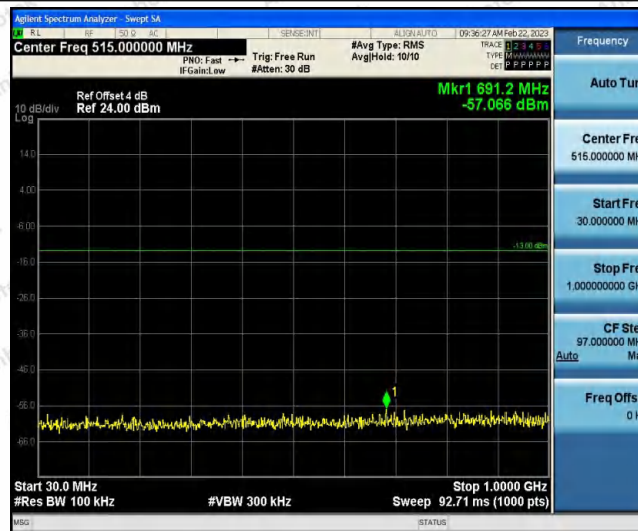

Band2-1.4MHz-QPSK-19193-1RB#0-Range2:1000~20000MHz

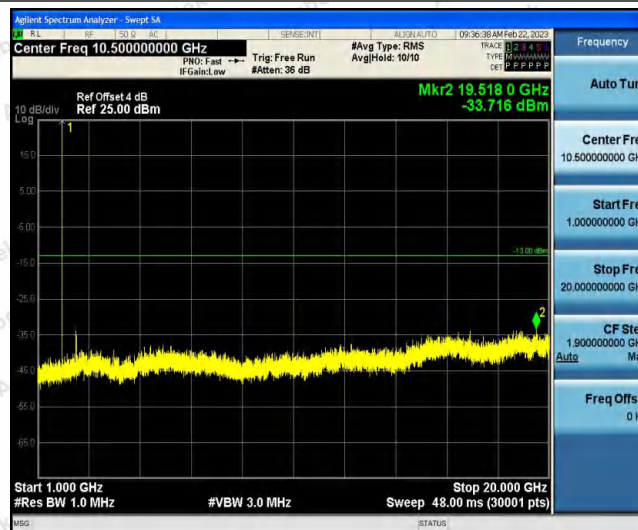

Band2-1.4MHz-16QAM-18607-1RB#0-Range1:30~1000MHz

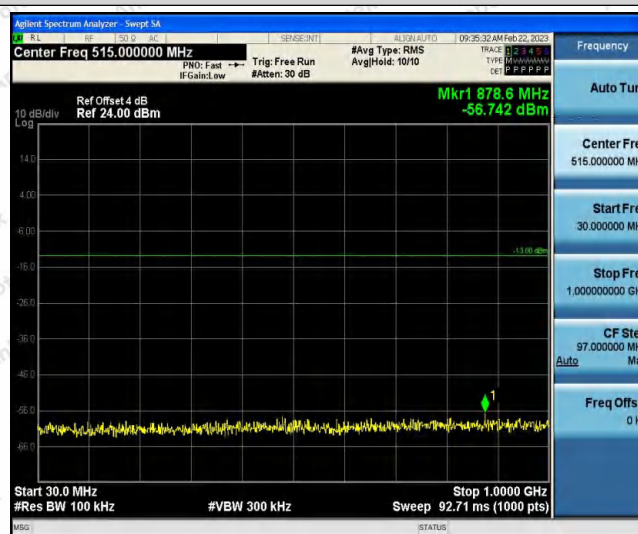

Band2-1.4MHz-16QAM-18607-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




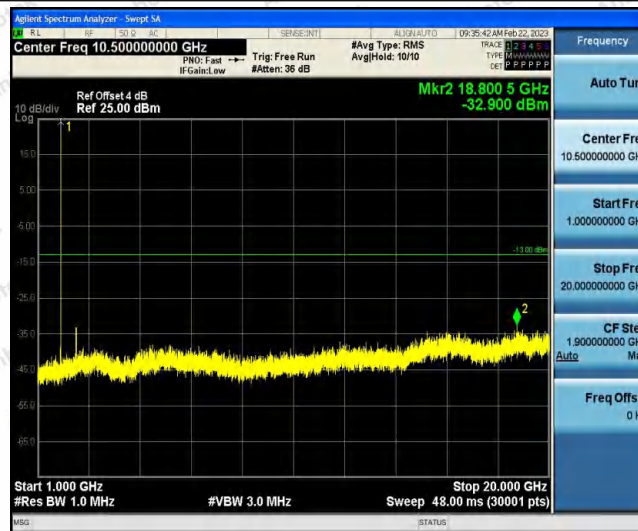

Band2-1.4MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

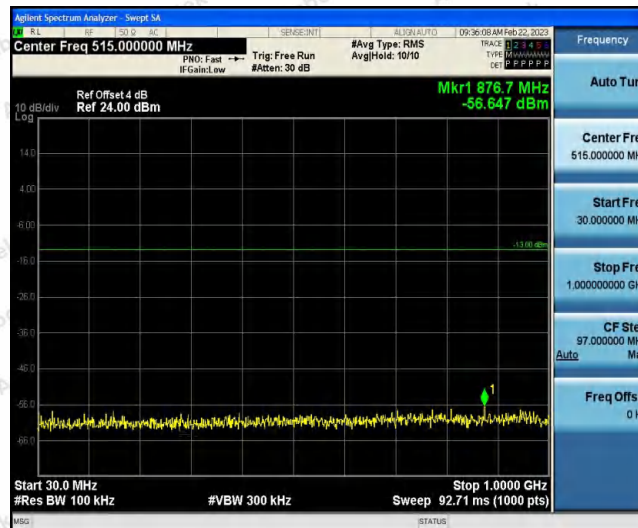

Band2-1.4MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

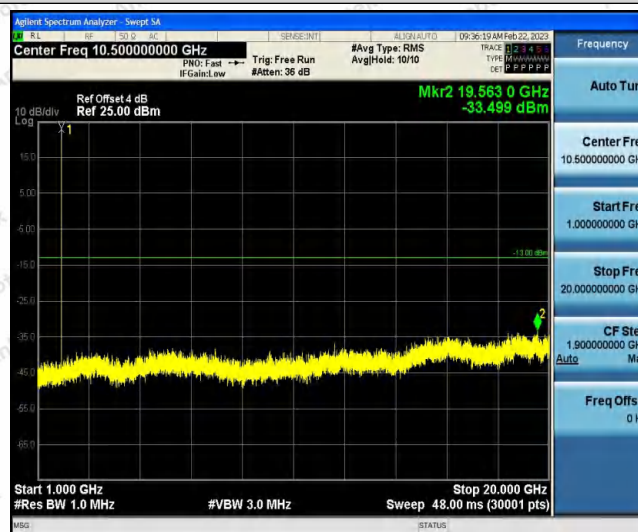

Band2-1.4MHz-16QAM-19193-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




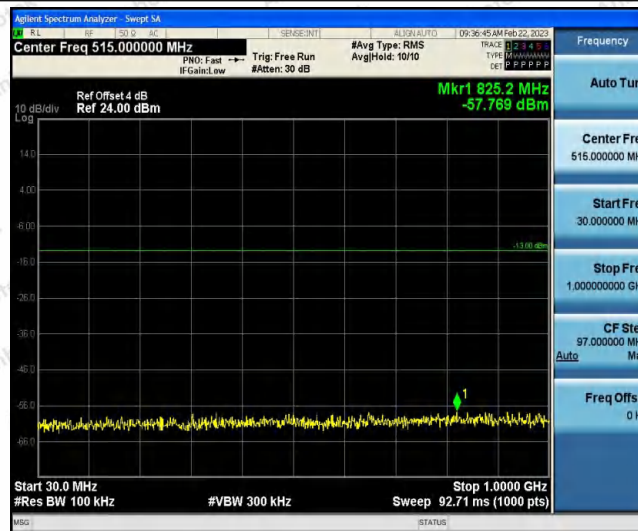

Band2-1.4MHz-16QAM-19193-1RB#0-Range2:1000~20000MHz



Band2-3MHz-QPSK-18615-1RB#0-Range1:30~1000MHz

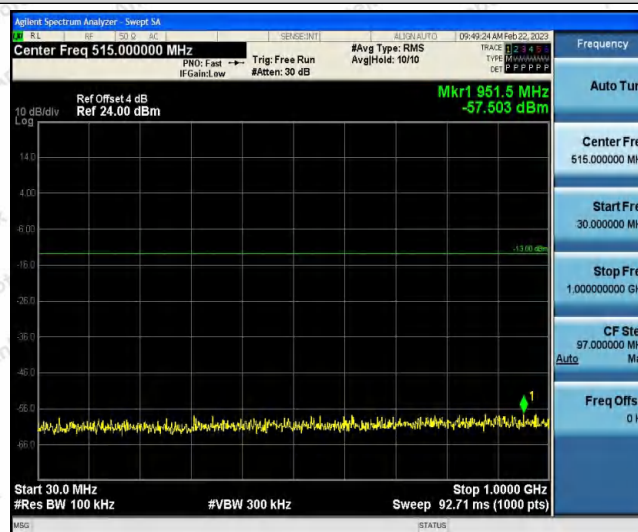

Band2-3MHz-QPSK-18615-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




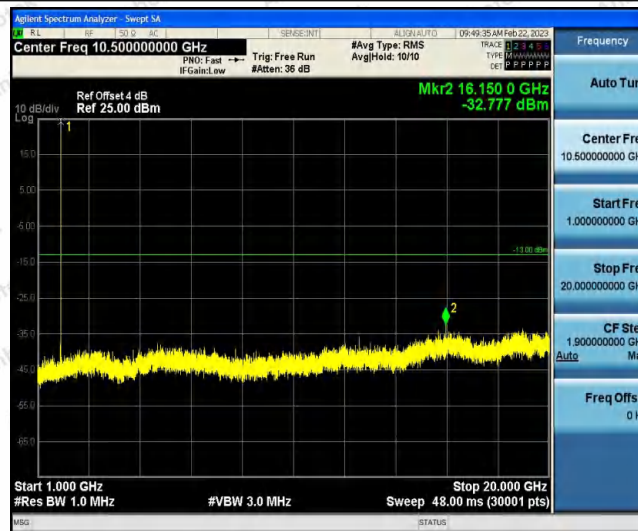

Band2-3MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

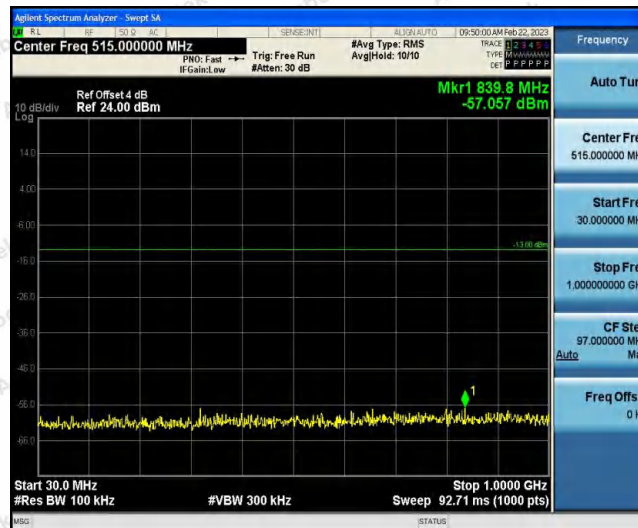

Band2-3MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

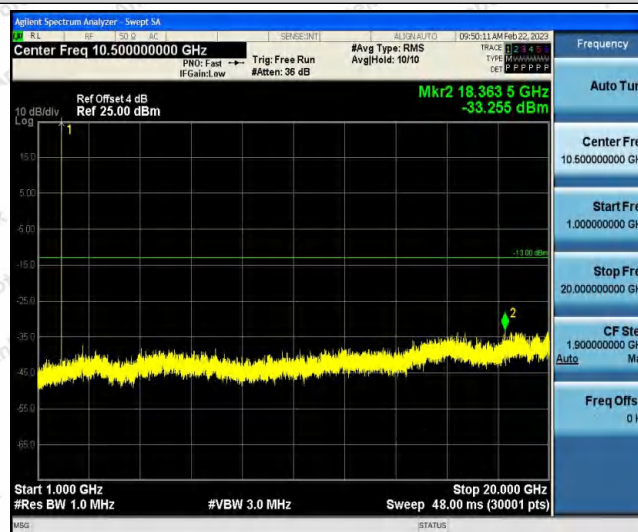

Band2-3MHz-QPSK-19185-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




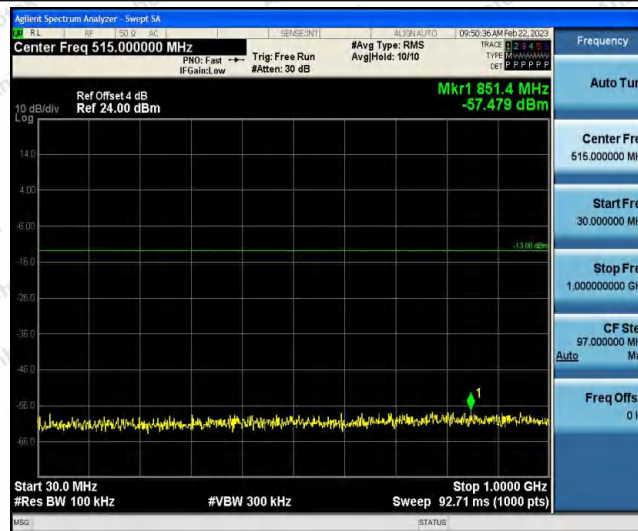

Band2-3MHz-QPSK-19185-1RB#0-Range2:1000~20000MHz

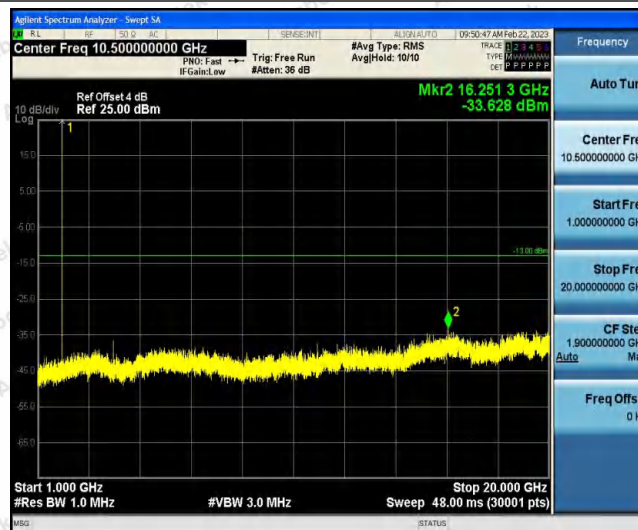

Band2-3MHz-16QAM-18615-1RB#0-Range1:30~1000MHz

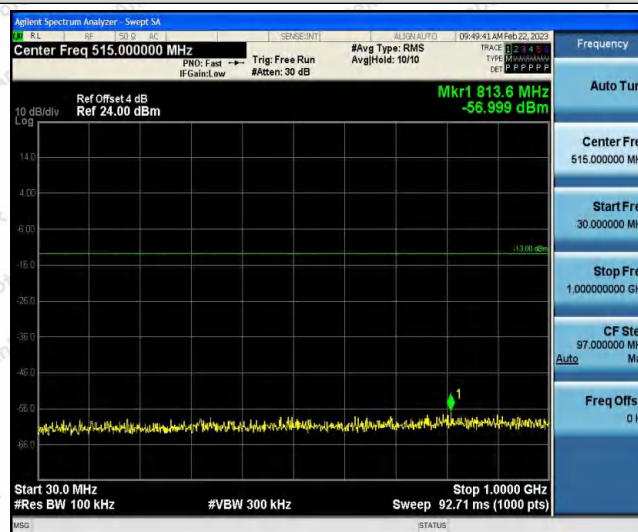

Band2-3MHz-16QAM-18615-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




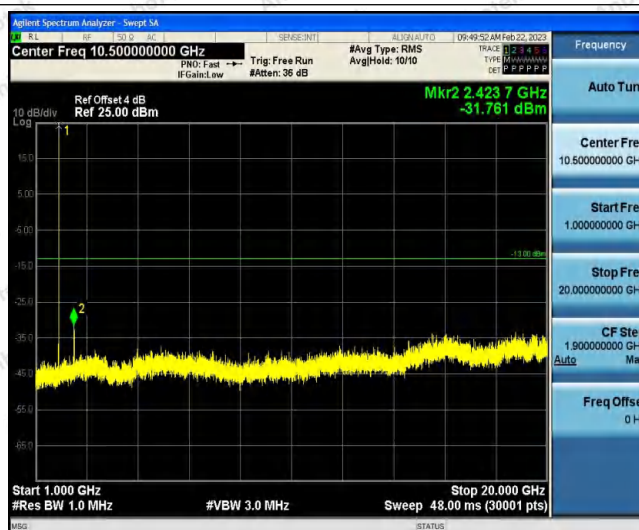

Band2-3MHz-16QAM-18900-1RB#0-Range1:30~1000MHz



Band2-3MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

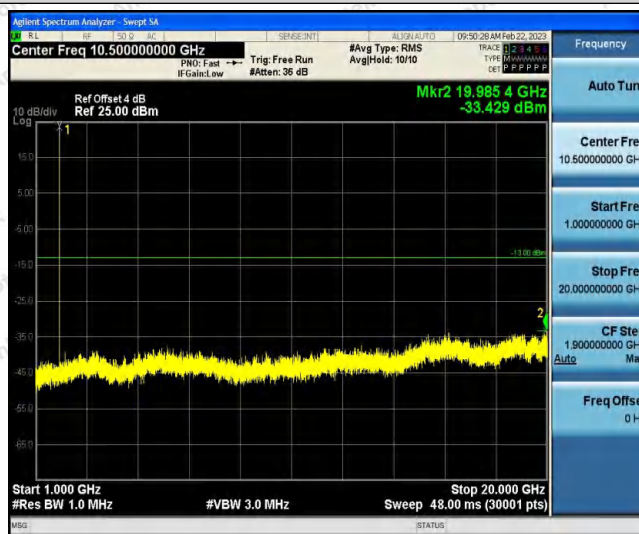

Band2-3MHz-16QAM-19185-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




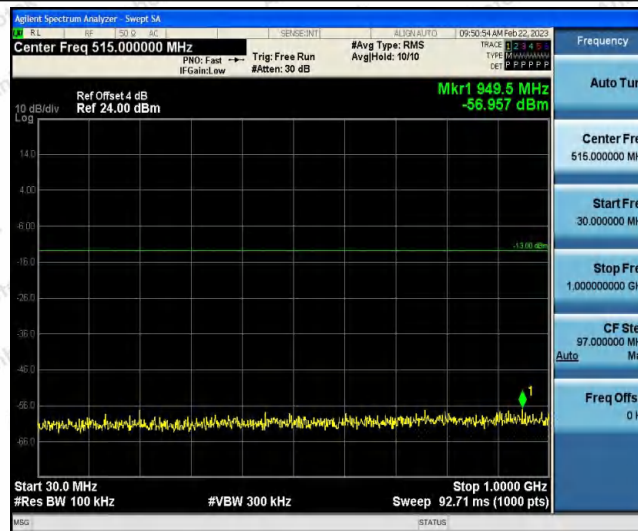

Band2-3MHz-16QAM-19185-1RB#0-Range2:1000~20000MHz

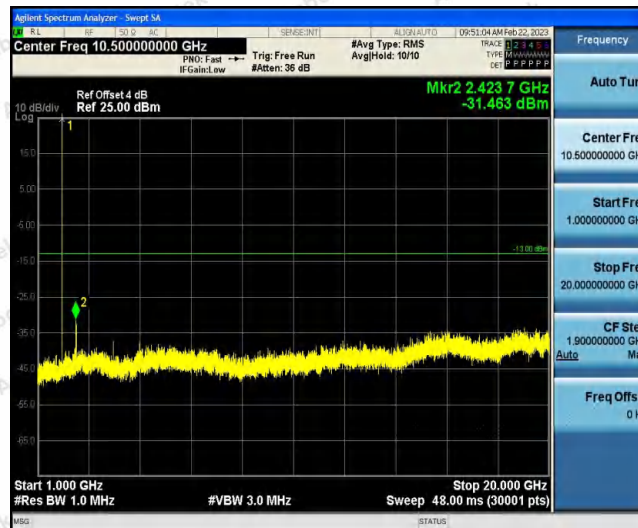

Band2-5MHz-QPSK-18625-1RB#0-Range1:30~1000MHz

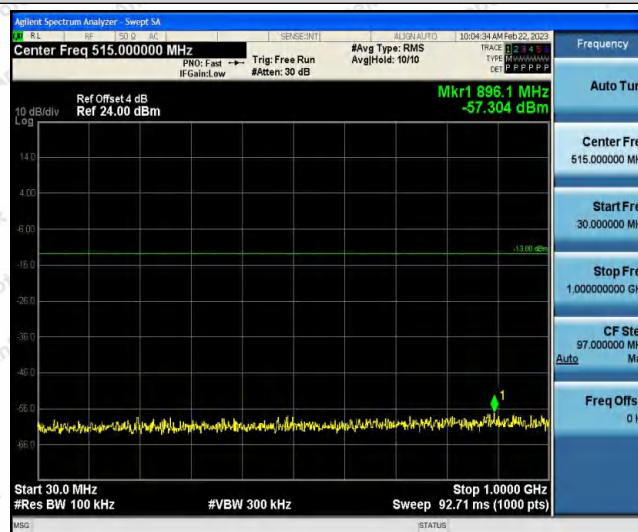

Band2-5MHz-QPSK-18625-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




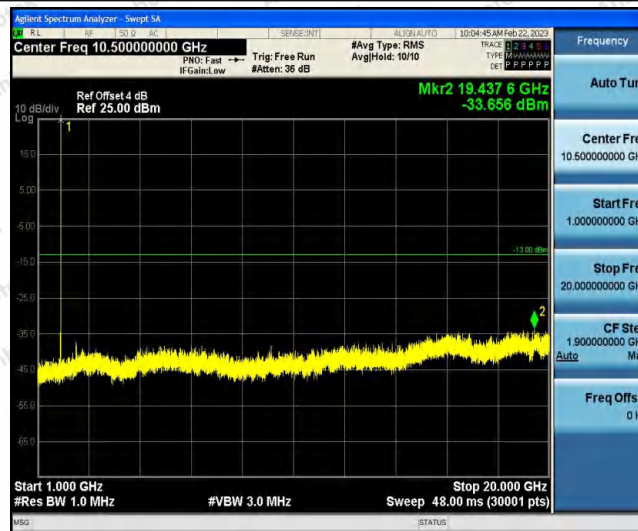

Band2-5MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

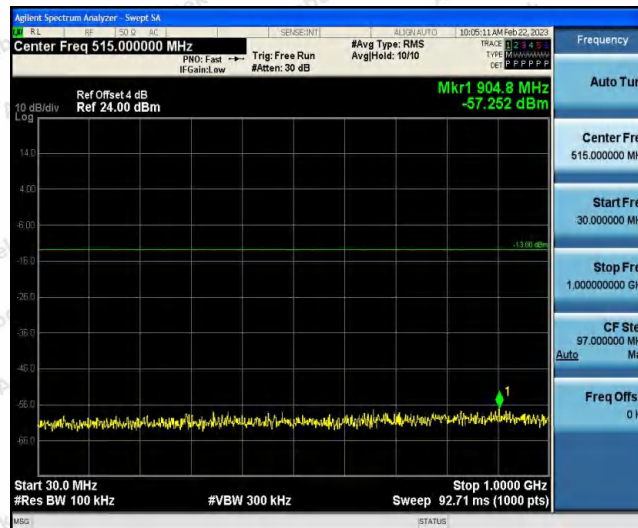

Band2-5MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

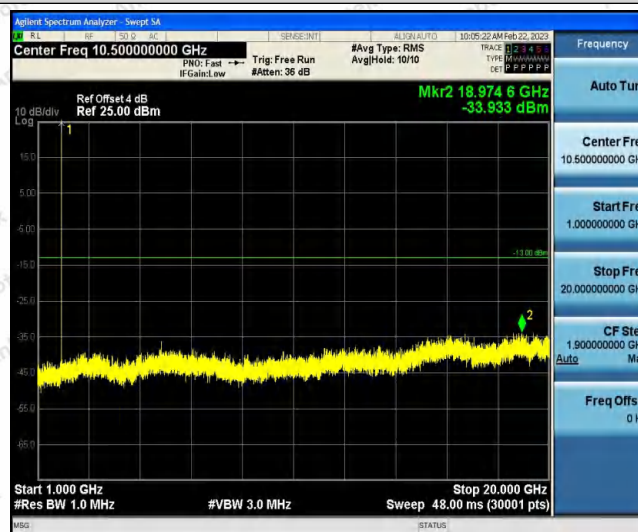

Band2-5MHz-QPSK-19175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




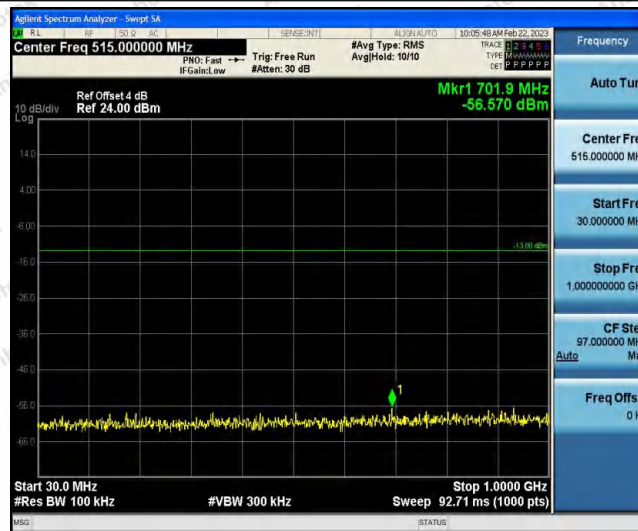

Band2-5MHz-QPSK-19175-1RB#0-Range2:1000~20000MHz

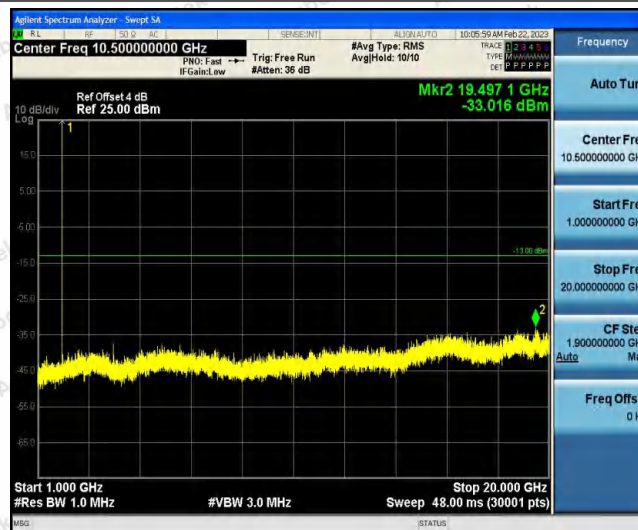

Band2-5MHz-16QAM-18625-1RB#0-Range1:30~1000MHz

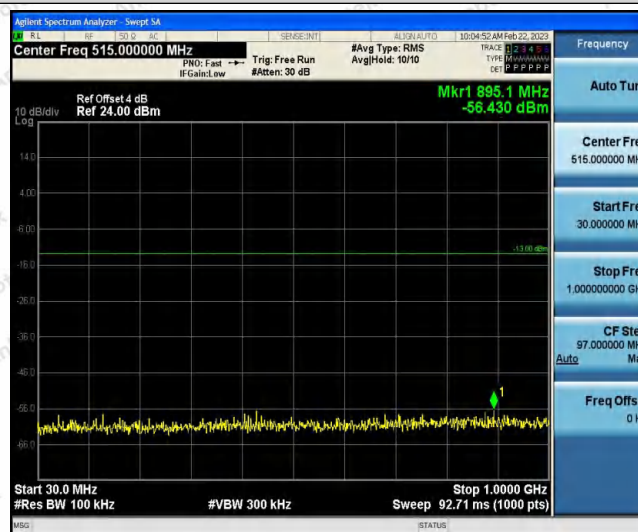

Band2-5MHz-16QAM-18625-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-5MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

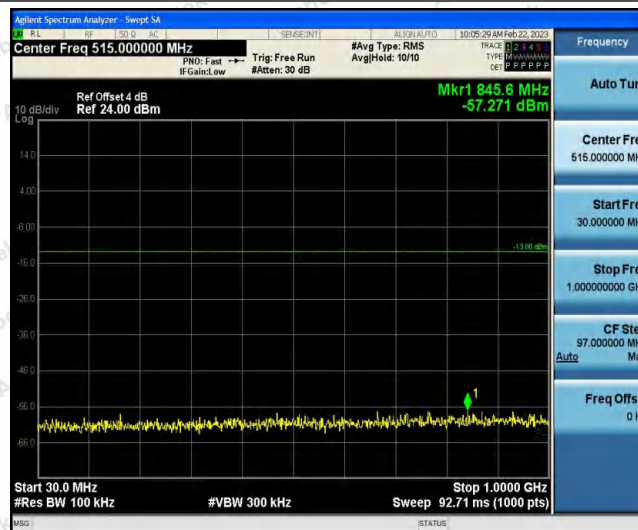

Band2-5MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

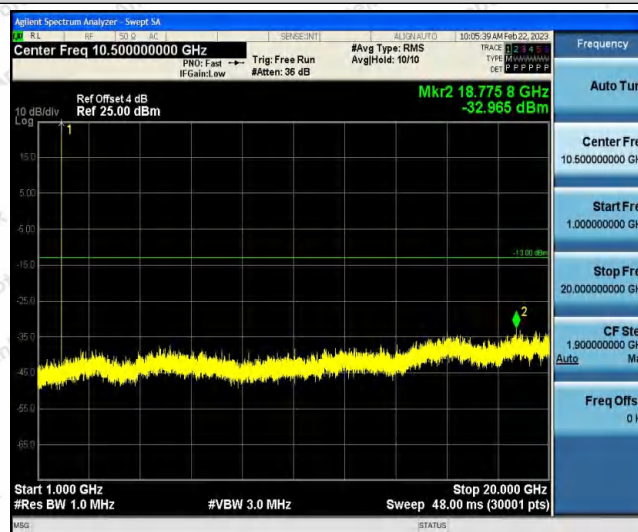

Band2-5MHz-16QAM-19175-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




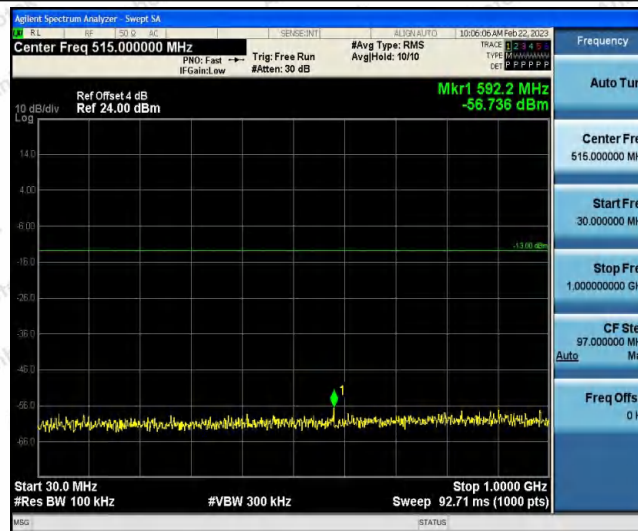

Band2-5MHz-16QAM-19175-1RB#0-Range2:1000~20000MHz



Band2-10MHz-QPSK-18650-1RB#0-Range1:30~1000MHz

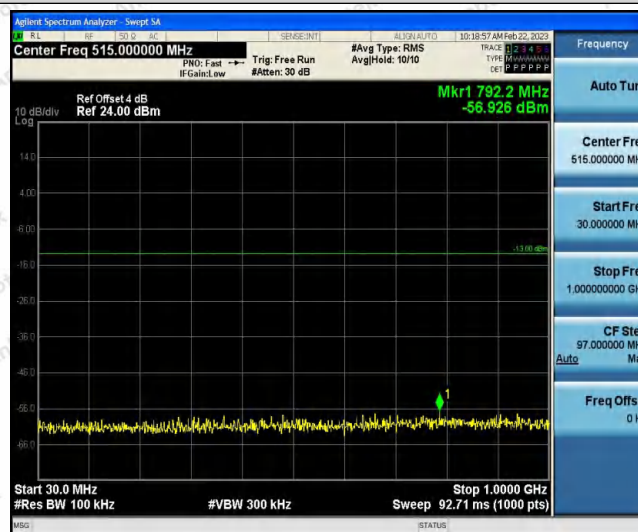

Band2-10MHz-QPSK-18650-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




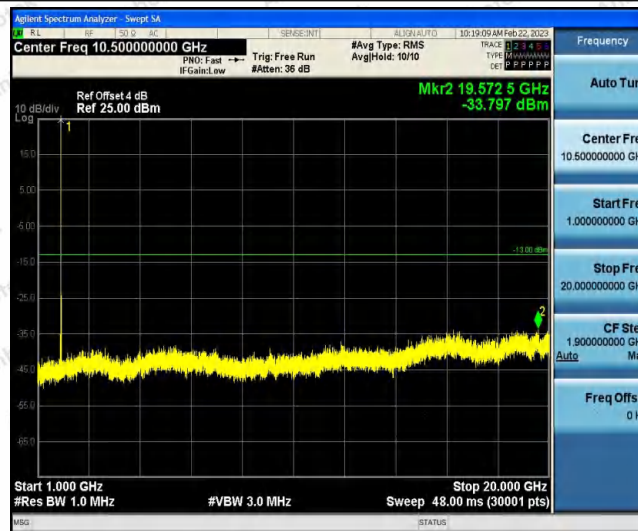

Band2-10MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

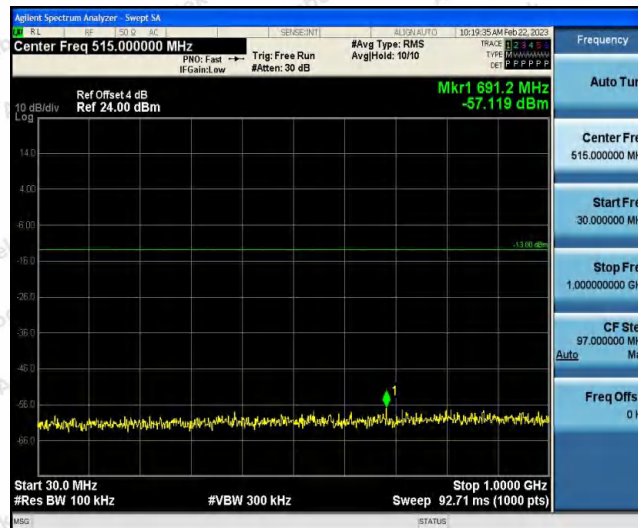


Band2-10MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

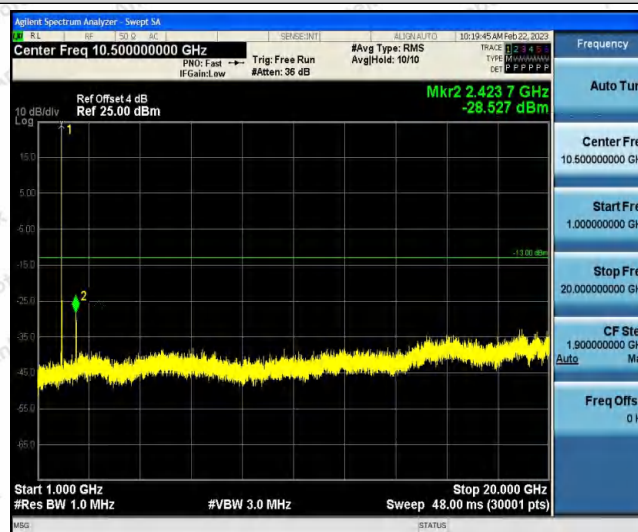

Band2-10MHz-QPSK-19150-1RB#0-Range1:30~1000MHz




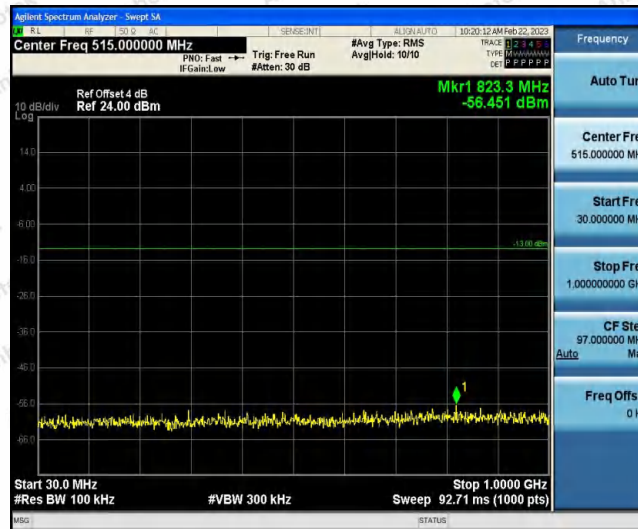

Band2-10MHz-QPSK-19150-1RB#0-Range2:1000~20000MHz



Band2-10MHz-16QAM-18650-1RB#0-Range1:30~1000MHz

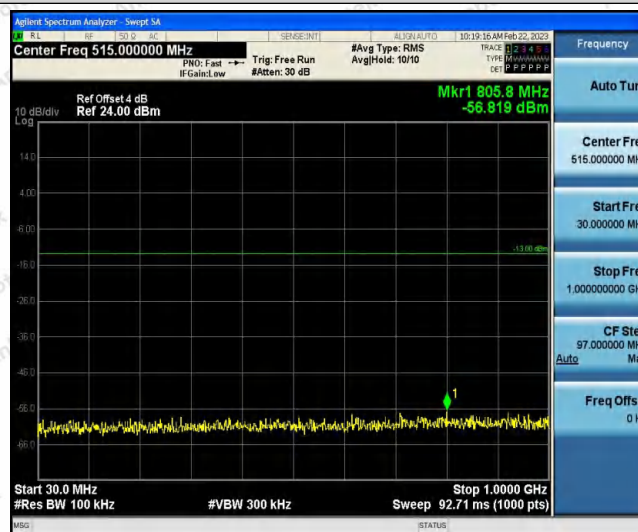

Band2-10MHz-16QAM-18650-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




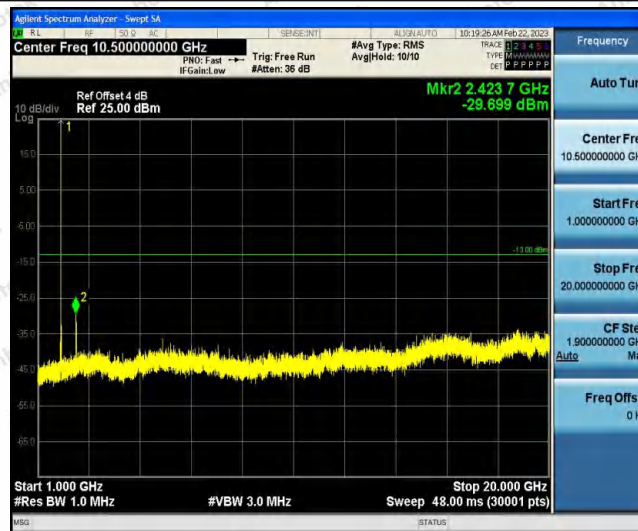

Band2-10MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

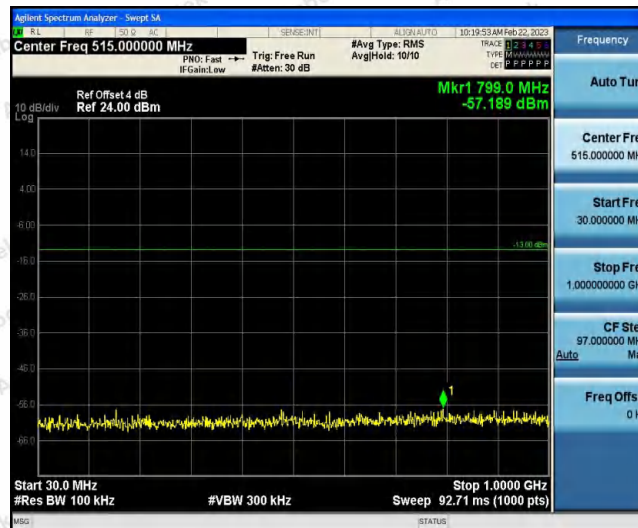

Band2-10MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

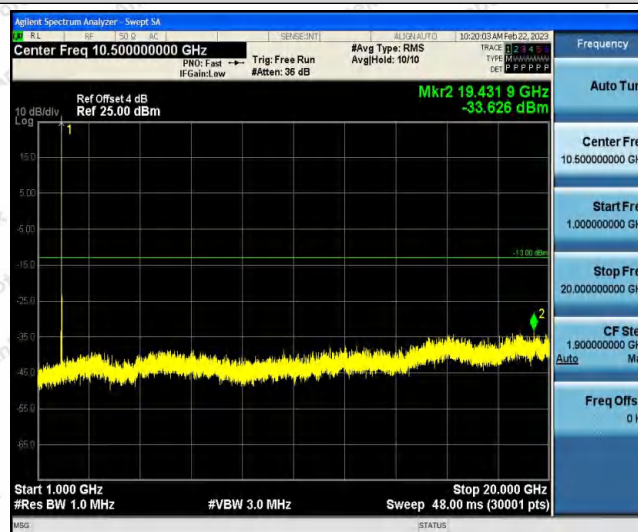

Band2-10MHz-16QAM-19150-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




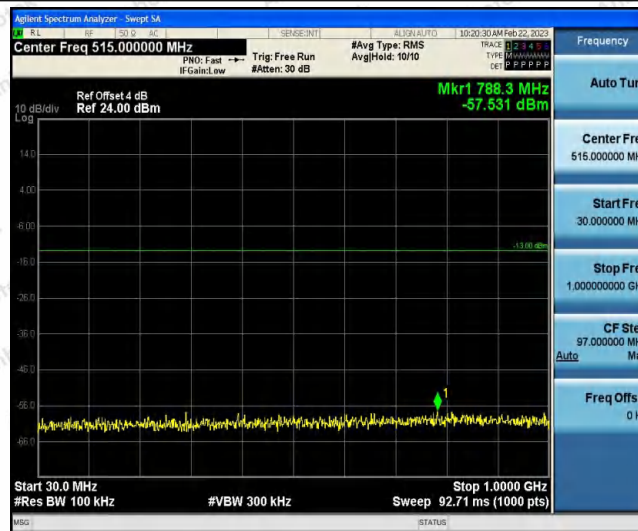

Band2-10MHz-16QAM-19150-1RB#0-Range2:1000~20000MHz

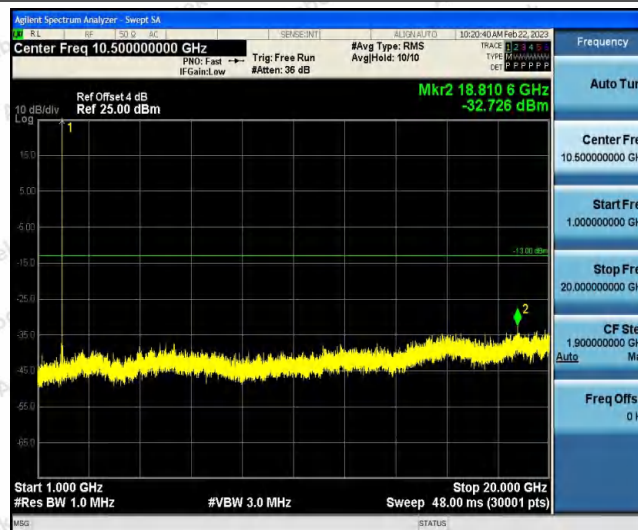

Band2-15MHz-QPSK-18675-1RB#0-Range1:30~1000MHz

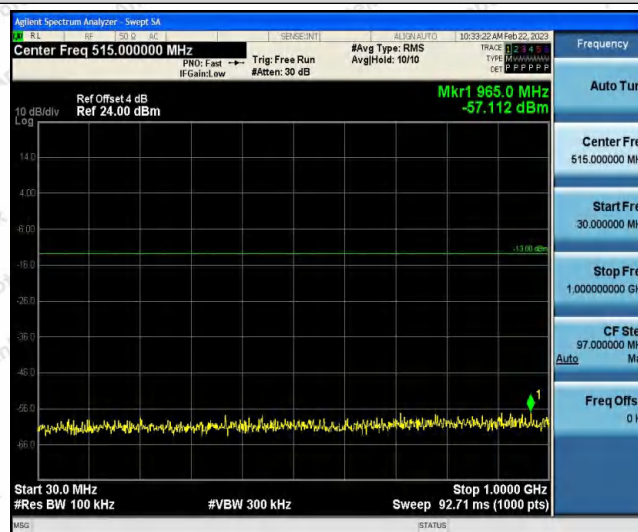

Band2-15MHz-QPSK-18675-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-15MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

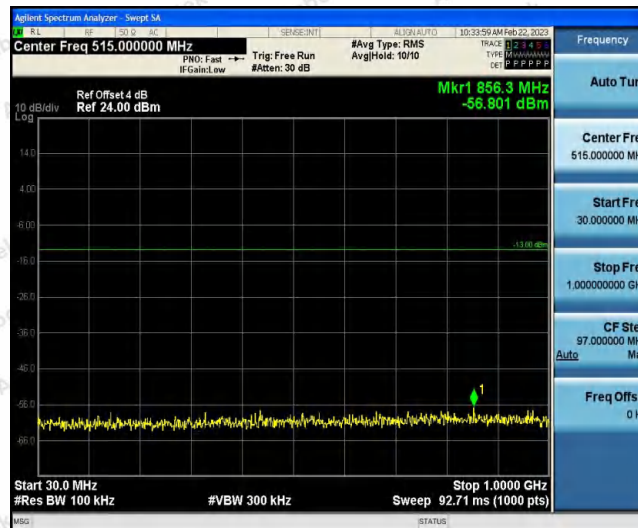

Band2-15MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

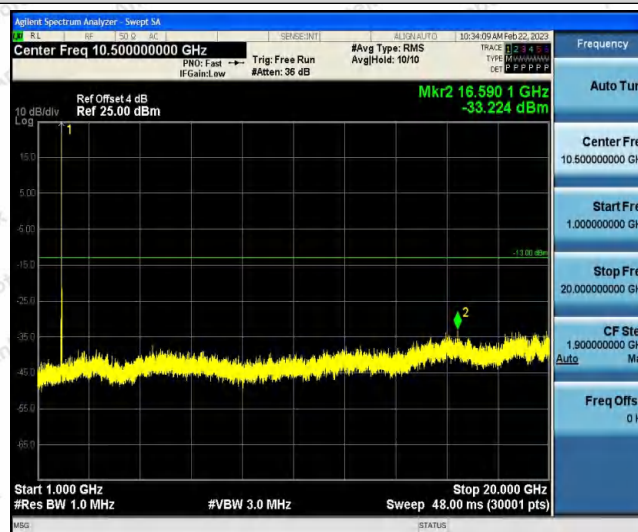

Band2-15MHz-QPSK-19125-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn




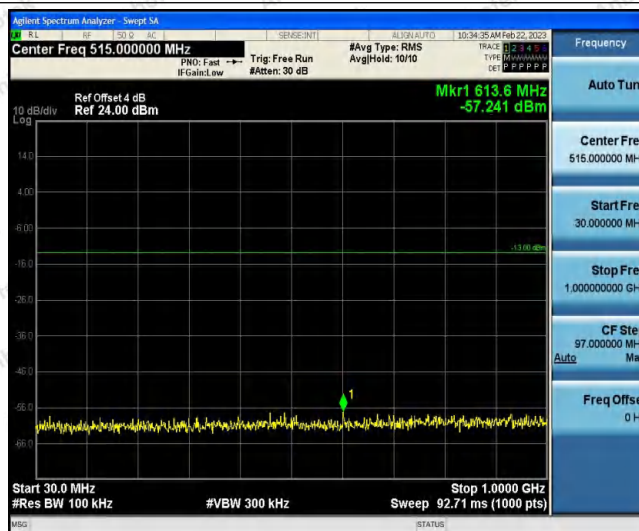

Band2-15MHz-QPSK-19125-1RB#0-Range2:1000~20000MHz



Band2-15MHz-16QAM-18675-1RB#0-Range1:30~1000MHz

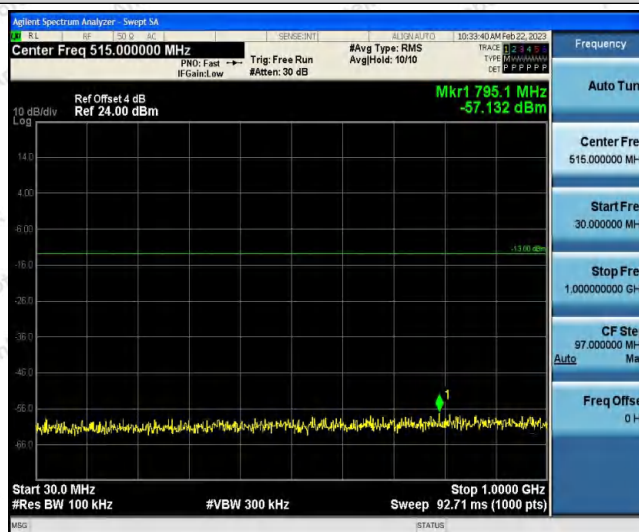

Band2-15MHz-16QAM-18675-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn






Band2-15MHz-16QAM-18900-1RB#0-Range1:30~1000MHz

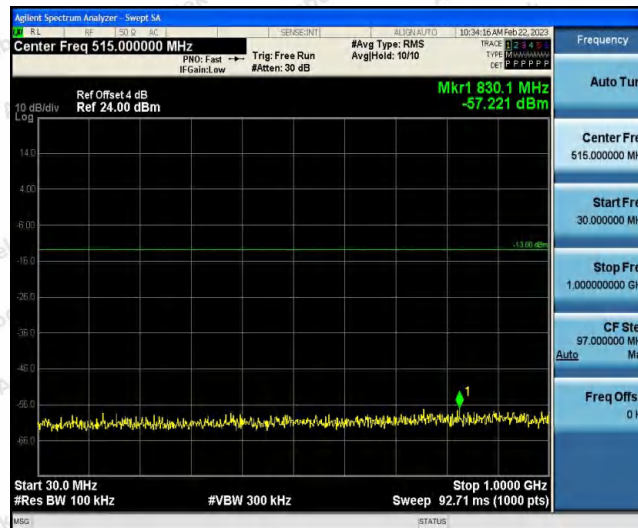

Band2-15MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

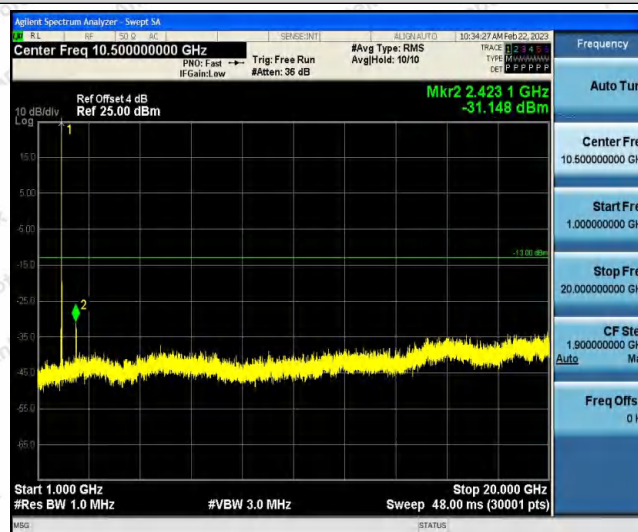

Band2-15MHz-16QAM-19125-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




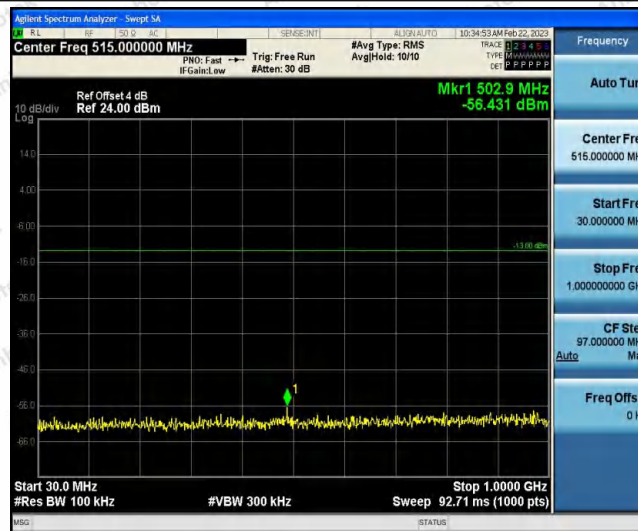

Band2-15MHz-16QAM-19125-1RB#0-Range2:1000~20000MHz

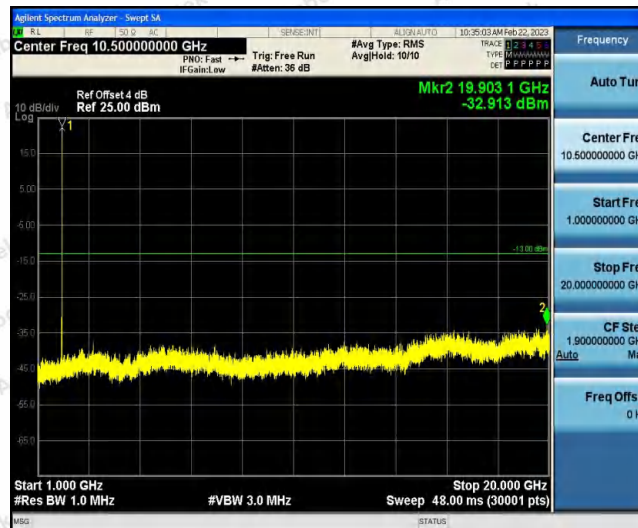

Band2-20MHz-QPSK-18700-1RB#0-Range1:30~1000MHz

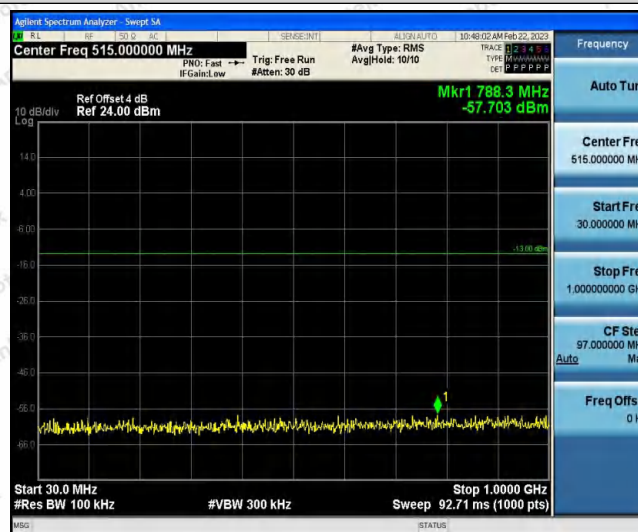

Band2-20MHz-QPSK-18700-1RB#0-Range2:1000~20000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




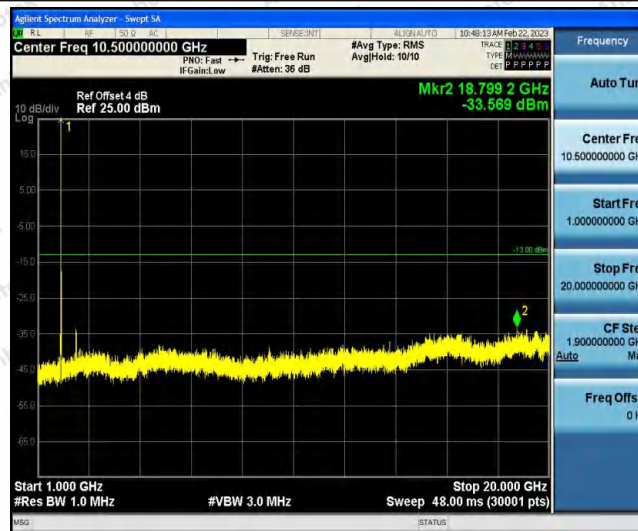

Band2-20MHz-QPSK-18900-1RB#0-Range1:30~1000MHz

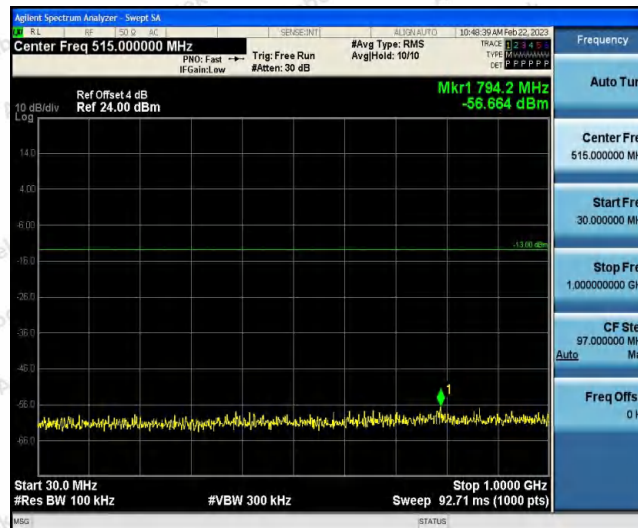

Band2-20MHz-QPSK-18900-1RB#0-Range2:1000~20000MHz

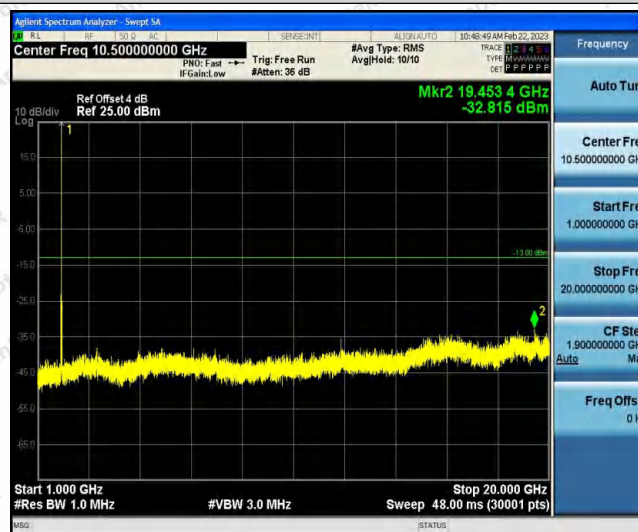

Band2-20MHz-QPSK-19100-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn




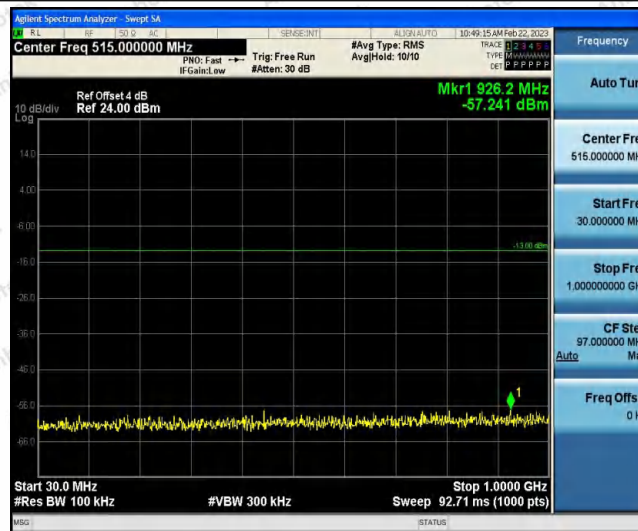

Band2-20MHz-QPSK-19100-1RB#0-Range2:1000~20000MHz

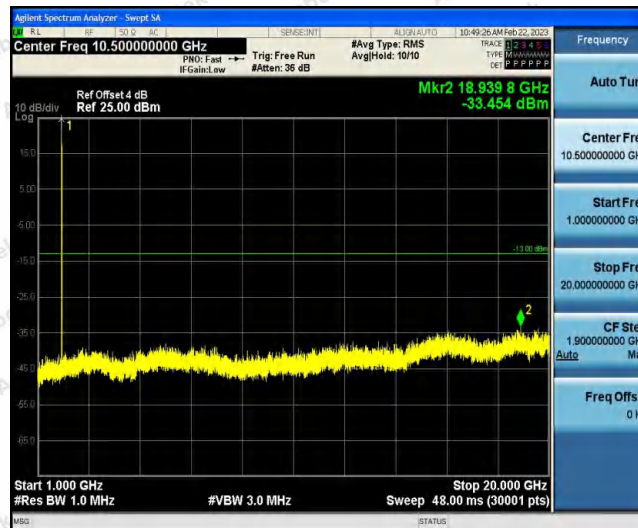

Band2-20MHz-16QAM-18700-1RB#0-Range1:30~1000MHz

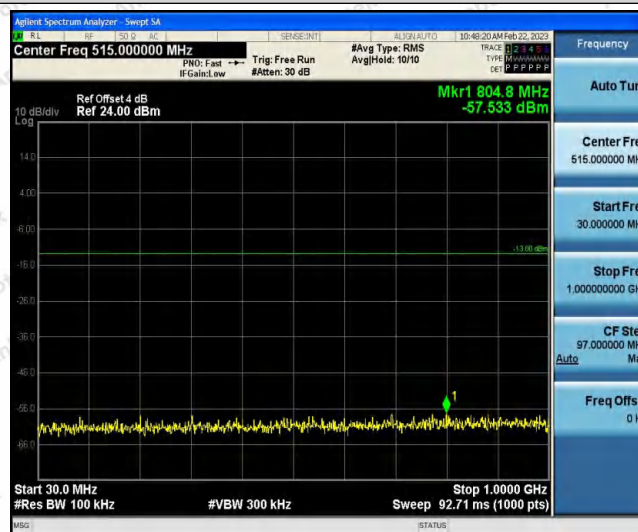

Band2-20MHz-16QAM-18700-1RB#0-Range2:1000~20000MHz

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn






Band2-20MHz-16QAM-18900-1RB#0-Range1:30~1000MHz



Band2-20MHz-16QAM-18900-1RB#0-Range2:1000~20000MHz

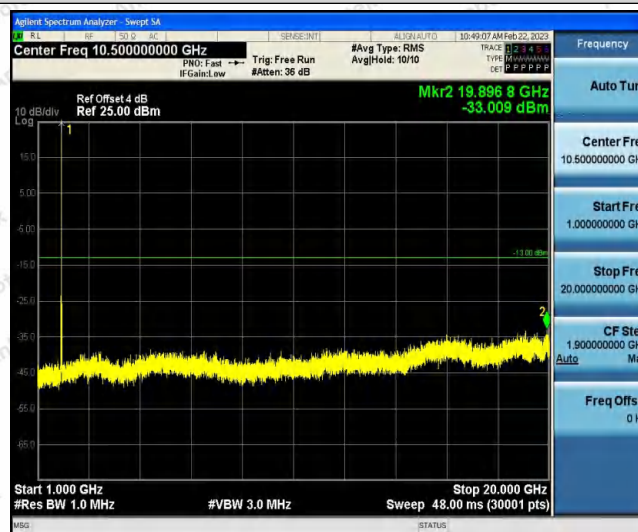

Band2-20MHz-16QAM-19100-1RB#0-Range1:30~1000MHz


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



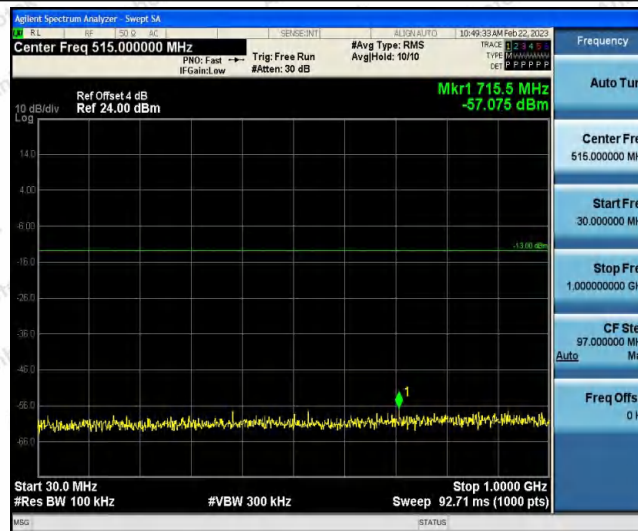

Band2-20MHz-16QAM-19100-1RB#0-Range2:1000~20000MHz

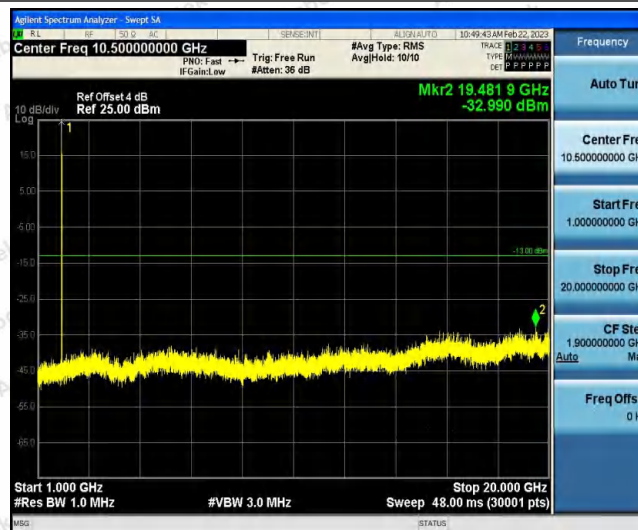

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-5.46	-0.002950	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-5.76	-0.003112	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-5.22	-0.002821	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-8.17	-0.004346	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	-5.72	-0.003043	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-6.34	-0.003372	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	2.89	0.001514	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-6.41	-0.003357	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-3.19	-0.001671	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-3.43	-0.001853	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-5.34	-0.002885	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-3.98	-0.002151	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-6.61	-0.003516	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-6.38	-0.003394	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-8.14	-0.004330	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	3.20	0.001676	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	2.27	0.001189	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-3.82	-0.002001	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-6.52	-0.003521	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-4.32	-0.002333	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-3.81	-0.002058	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-8.78	-0.004670	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	-6.34	-0.003372	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	-8.47	-0.004505	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	2.63	0.001378	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	-3.46	-0.001813	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	-3.45	-0.001808	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-5.28	-0.002852	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-4.79	-0.002587	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-5.56	-0.003003	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-5.76	-0.003064	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-6.77	-0.003601	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	-5.82	-0.003096	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-5.02	-0.002630	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-3.72	-0.001949	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-4.78	-0.002505	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-3.29	-0.001776	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-3.96	-0.002138	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-6.85	-0.003698	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-7.80	-0.004149	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	-5.64	-0.003000	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-5.52	-0.002936	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	3.06	0.001604	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	3.69	0.001934	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-3.66	-0.001919	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	-5.81	-0.003136	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-4.02	-0.002170	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-4.99	-0.002694	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-7.32	-0.003894	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	-6.34	-0.003372	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-7.90	-0.004202	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-5.71	-0.002993	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-2.43	-0.001274	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	3.91	0.002050	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-3.58	-0.001930	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-4.56	-0.002458	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-7.08	-0.003817	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-6.22	-0.003309	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	-5.56	-0.002957	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-5.24	-0.002787	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	2.26	0.001186	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	5.51	0.002892	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	3.81	0.002000	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-7.18	-0.003871	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-3.89	-0.002097	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-4.02	-0.002167	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	-7.24	-0.003851	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	-3.92	-0.002085	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	-5.65	-0.003005	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	2.89	0.001517	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	3.69	0.001937	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	2.93	0.001538	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-7.02	-0.003779	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-6.42	-0.003456	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-4.65	-0.002503	±2.5	PASS



Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-5.52	-0.002936	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	-6.78	-0.003606	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-5.91	-0.003144	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-5.19	-0.002728	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-5.42	-0.002849	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-7.04	-0.003700	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VL	NT	-6.57	-0.003537	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	-6.55	-0.003526	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	-7.14	-0.003844	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-11.36	-0.006043	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	-4.62	-0.002457	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-9.27	-0.004931	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	-5.06	-0.002660	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	-6.81	-0.003580	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	-8.90	-0.004678	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	4.76	0.002559	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	4.16	0.002237	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	3.32	0.001785	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-8.58	-0.004564	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	-6.84	-0.003638	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-6.37	-0.003388	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-8.28	-0.004358	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-5.68	-0.002989	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-9.00	-0.004737	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	6.08	0.003269	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	2.90	0.001559	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	5.18	0.002785	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	-9.04	-0.004809	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	-7.61	-0.004048	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	-6.91	-0.003676	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-6.87	-0.003616	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-4.38	-0.002305	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-5.55	-0.002921	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-3.56	-0.001924	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-2.30	-0.001243	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-3.58	-0.001934	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-3.29	-0.001778	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-7.87	-0.004252	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-8.64	-0.004596	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-8.74	-0.004649	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-6.75	-0.003590	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-8.80	-0.004681	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-7.84	-0.004170	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	3.99	0.002090	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-2.56	-0.001341	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-5.08	-0.002661	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	2.82	0.001477	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	3.30	0.001728	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-5.41	-0.002923	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-4.55	-0.002459	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-6.22	-0.003361	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-7.27	-0.003928	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-4.68	-0.002529	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-5.61	-0.002984	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-5.82	-0.003096	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-6.87	-0.003654	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-7.54	-0.004011	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-6.68	-0.003553	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	5.99	0.003137	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	3.65	0.001912	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	4.08	0.002137	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	3.38	0.001770	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-3.66	-0.001917	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-4.49	-0.002425	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-7.07	-0.003819	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-4.72	-0.002549	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-4.56	-0.002463	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-2.79	-0.001507	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-6.64	-0.003532	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-6.07	-0.003229	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-4.32	-0.002298	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-6.02	-0.003202	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-5.22	-0.002777	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	2.17	0.001137	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-2.85	-0.001493	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	3.73	0.001954	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	4.71	0.002468	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-5.55	-0.002908	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-7.81	-0.004218	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-4.56	-0.002463	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-2.93	-0.001583	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	-6.11	-0.003300	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-3.16	-0.001707	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	-6.84	-0.003638	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-5.95	-0.003165	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	-6.07	-0.003229	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	-7.45	-0.003963	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	-8.90	-0.004734	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-2.98	-0.001561	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	3.55	0.001860	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	2.90	0.001520	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-4.39	-0.002300	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	2.29	0.001200	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-5.66	-0.003055	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-4.41	-0.002381	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-4.11	-0.002219	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-5.79	-0.003126	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-4.52	-0.002440	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-5.92	-0.003149	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-5.12	-0.002723	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-5.55	-0.002952	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-7.80	-0.004149	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-5.25	-0.002793	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-5.44	-0.002852	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-4.98	-0.002611	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	3.53	0.001851	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-5.87	-0.003077	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-5.01	-0.002626	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-4.09	-0.002208	±2.5	PASS



Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-4.08	-0.002202	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-4.28	-0.002310	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	-5.34	-0.002883	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-6.08	-0.003282	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	-7.78	-0.004138	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-7.85	-0.004176	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	-7.02	-0.003734	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	-5.89	-0.003133	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-5.82	-0.003096	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	2.27	0.001190	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-3.72	-0.001950	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	-5.41	-0.002836	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	4.21	0.002207	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	4.02	0.002107	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-5.89	-0.003175	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-8.37	-0.004512	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-4.96	-0.002674	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-5.55	-0.002992	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-4.51	-0.002431	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-5.45	-0.002899	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-8.80	-0.004681	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-5.55	-0.002952	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-6.92	-0.003681	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-5.94	-0.003160	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-2.19	-0.001150	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	6.48	0.003402	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	4.96	0.002604	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	4.06	0.002131	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-2.35	-0.001234	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-5.29	-0.002852	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-4.68	-0.002523	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-7.32	-0.003946	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-5.45	-0.002938	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-5.25	-0.002830	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	-8.27	-0.004399	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	-5.91	-0.003144	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	-3.30	-0.001755	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-6.14	-0.003266	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	-4.84	-0.002574	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	3.46	0.001816	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	2.88	0.001512	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band2	10MHz	16QAM	19150	50RB#0	NV	0	6.69	0.003512	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	-5.79	-0.003039	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	4.26	0.002236	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-7.35	-0.003957	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-5.66	-0.003047	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-8.24	-0.004436	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-6.21	-0.003343	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-8.07	-0.004345	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-7.88	-0.004191	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-7.65	-0.004069	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-6.48	-0.003447	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-6.71	-0.003569	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-7.88	-0.004191	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-4.95	-0.002602	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-5.55	-0.002917	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-5.81	-0.003054	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-9.23	-0.004852	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-6.05	-0.003180	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	-4.43	-0.002385	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	-8.53	-0.004592	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	-9.54	-0.005136	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	-9.71	-0.005227	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	-8.64	-0.004651	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	-7.05	-0.003750	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	-7.40	-0.003936	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	-5.91	-0.003144	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	-6.28	-0.003340	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	-6.09	-0.003239	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	-6.17	-0.003243	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	-7.44	-0.003911	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	-7.41	-0.003895	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	-5.98	-0.003143	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	-5.89	-0.003096	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	5.04	0.002710	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	3.13	0.001683	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	3.53	0.001898	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	2.86	0.001538	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	3.93	0.002113	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-6.90	-0.003670	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-5.92	-0.003149	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-5.82	-0.003096	±2.5	PASS



Band2	20MHz	QPSK	18900	100RB#0	NV	10	-7.87	-0.004186	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-7.02	-0.003734	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-6.34	-0.003337	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-7.12	-0.003747	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-5.69	-0.002995	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-5.24	-0.002758	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-6.11	-0.003216	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	-4.66	-0.002505	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	4.25	0.002285	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	-1.57	-0.000844	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	-3.59	-0.001930	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	5.68	0.003054	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	-6.78	-0.003606	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	-7.40	-0.003936	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-5.94	-0.003160	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	-7.72	-0.004106	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	-8.87	-0.004718	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-6.42	-0.003379	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-5.26	-0.002768	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-5.89	-0.003100	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	10	-7.54	-0.003968	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-4.59	-0.002416	±2.5	PASS

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn

