






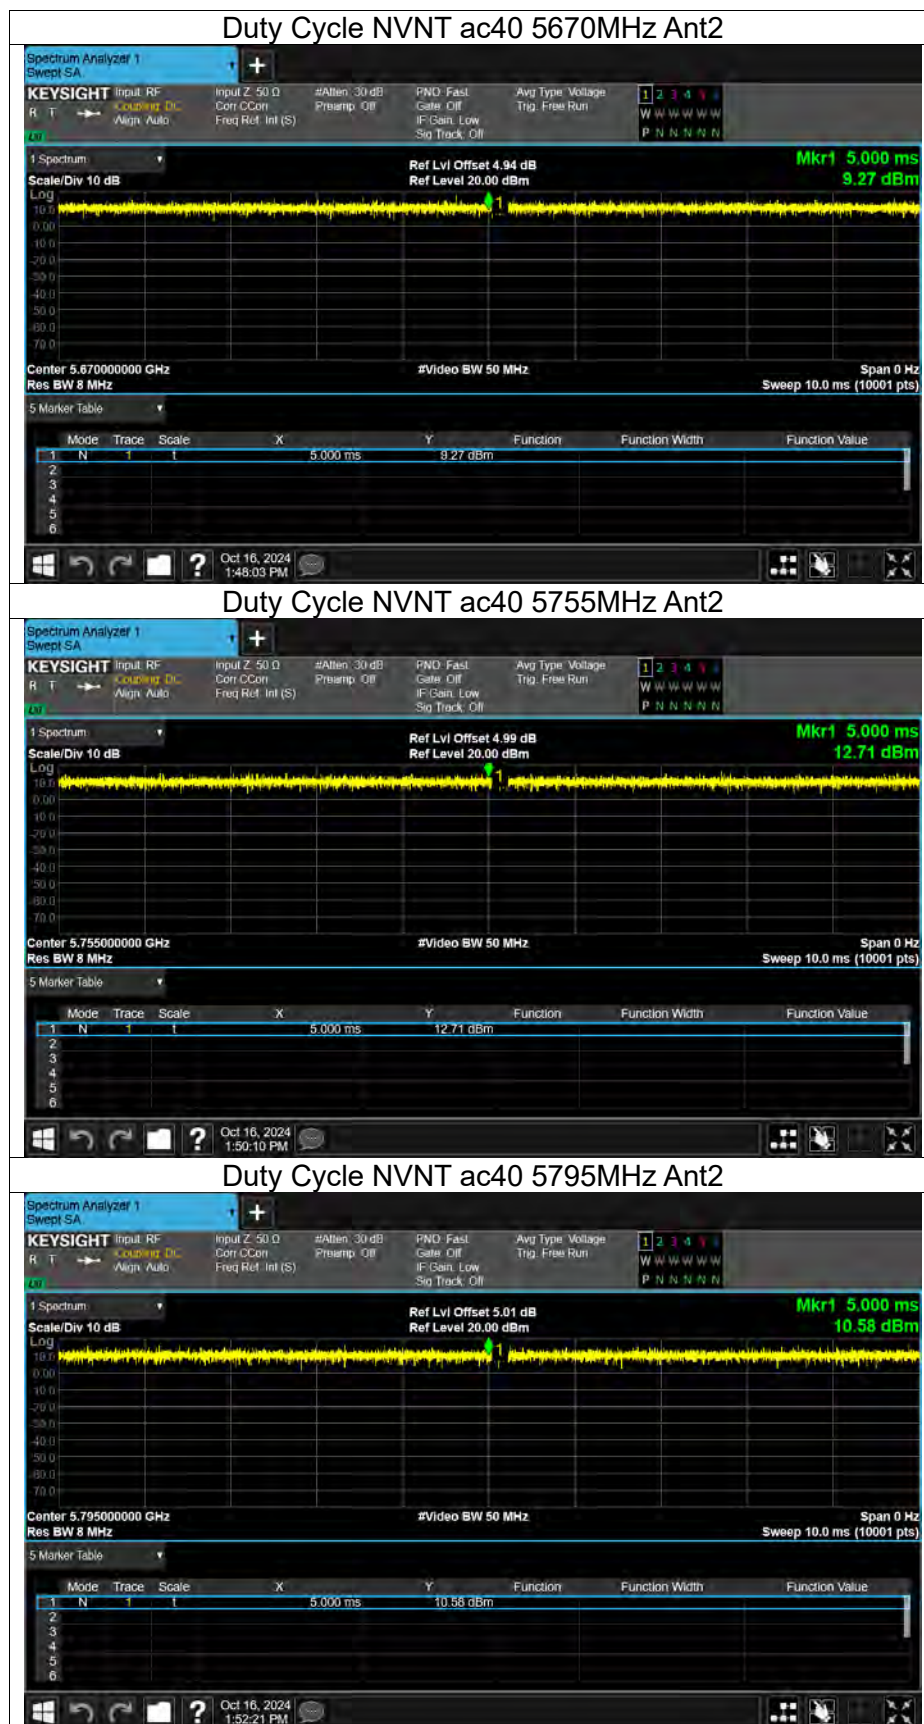


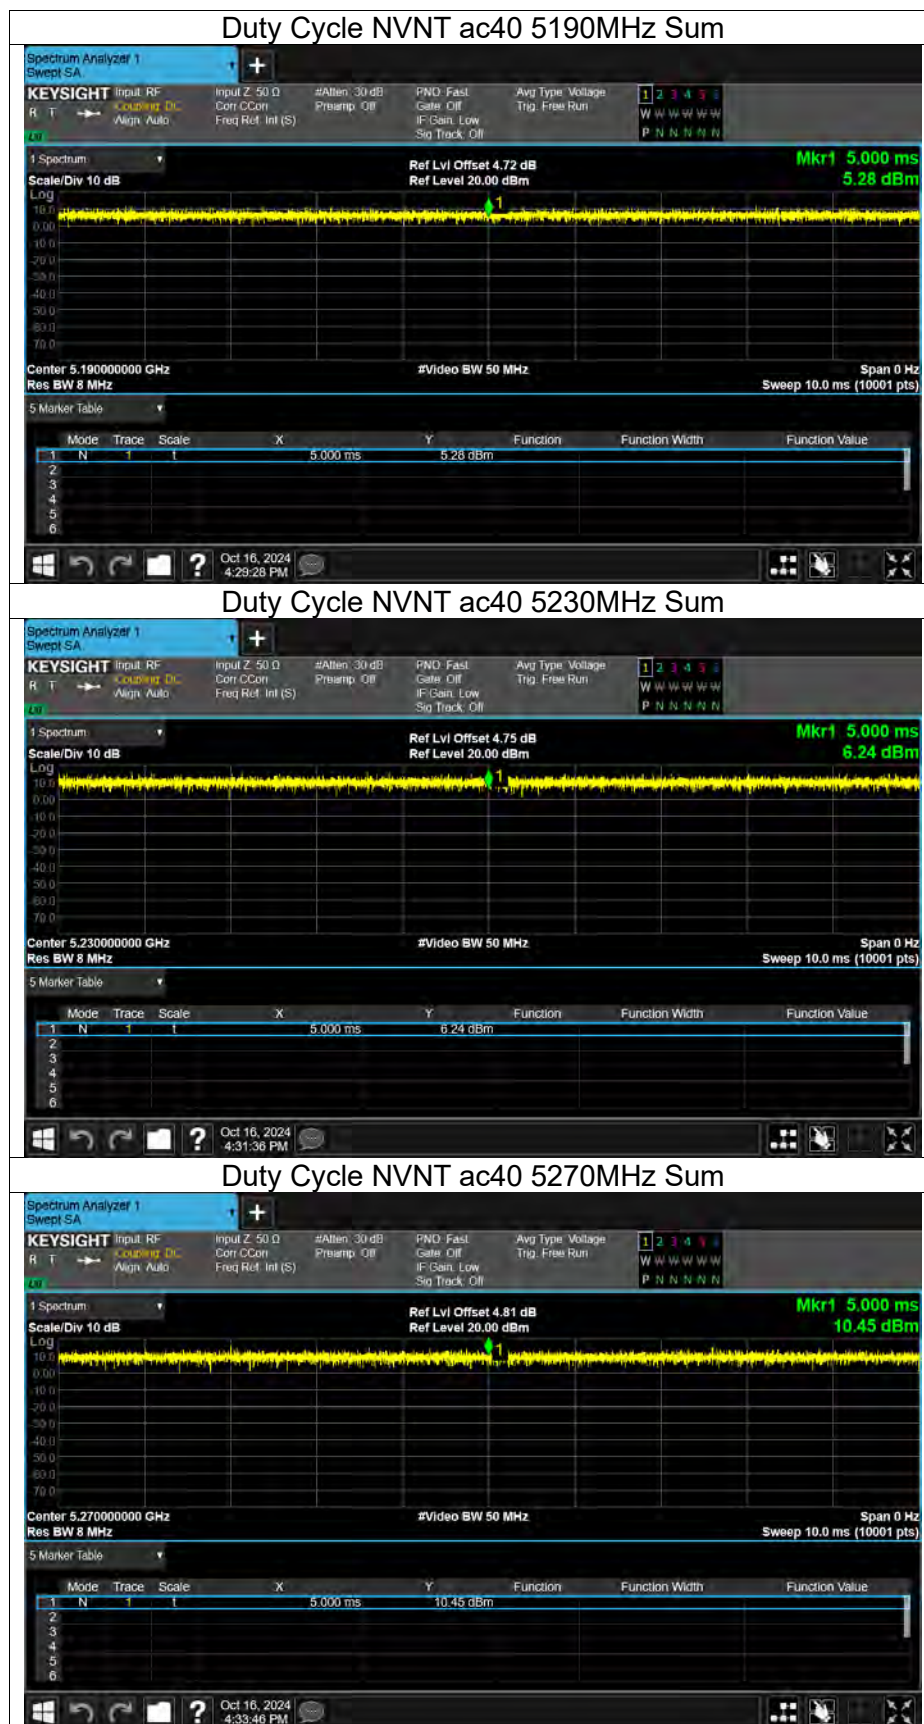


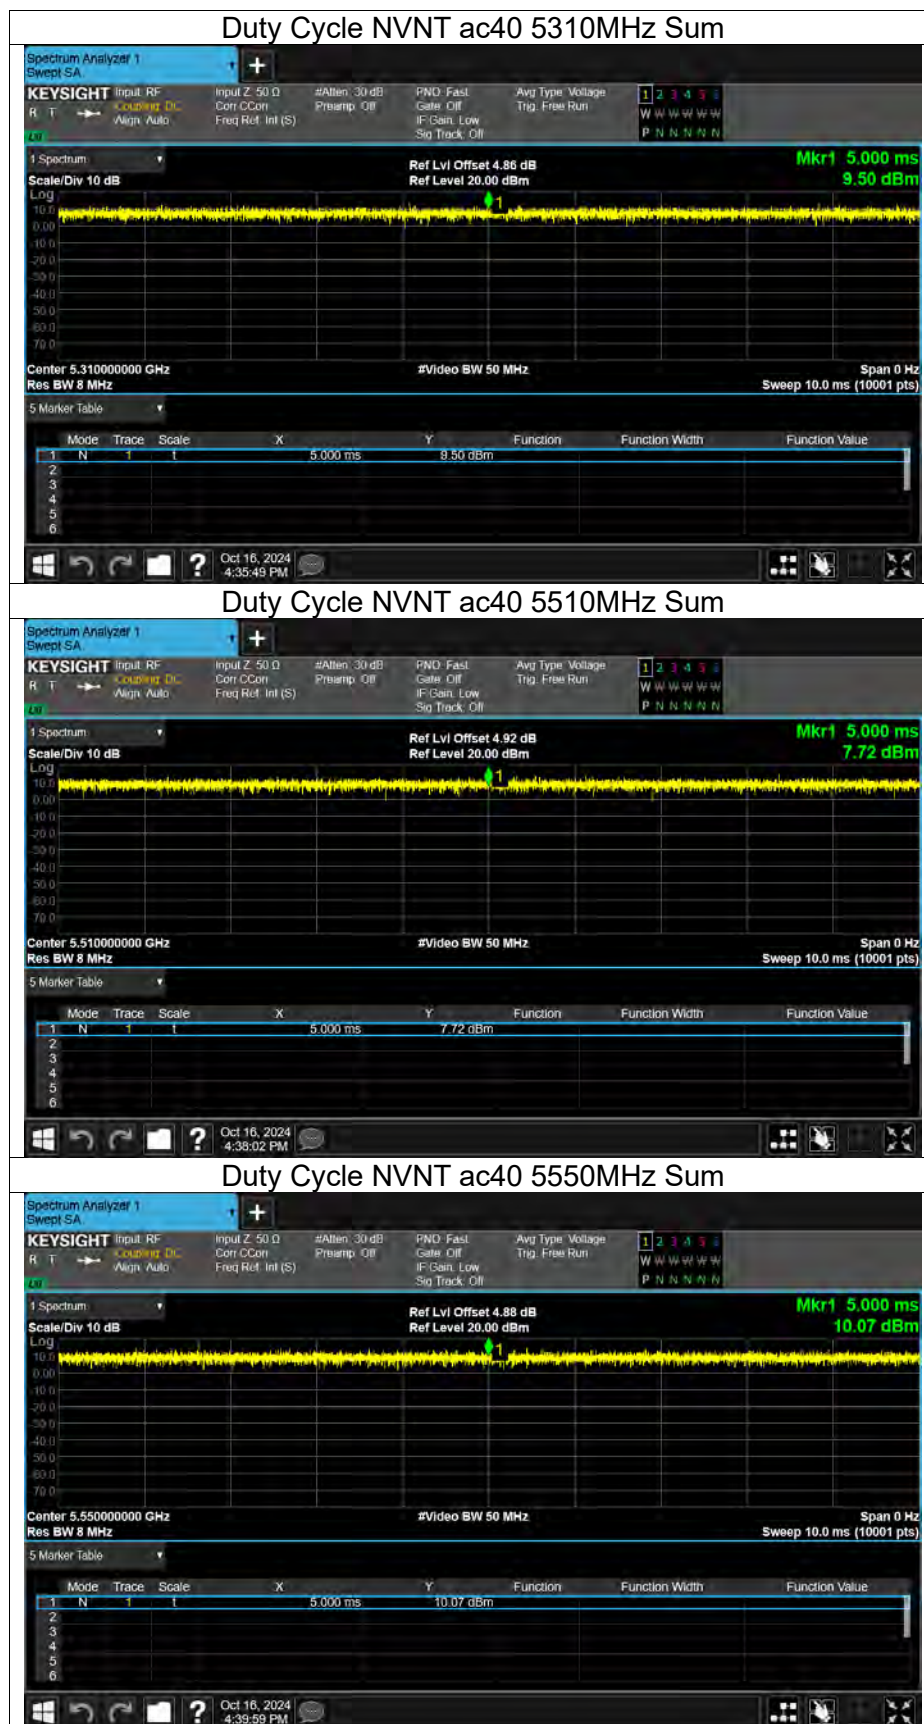


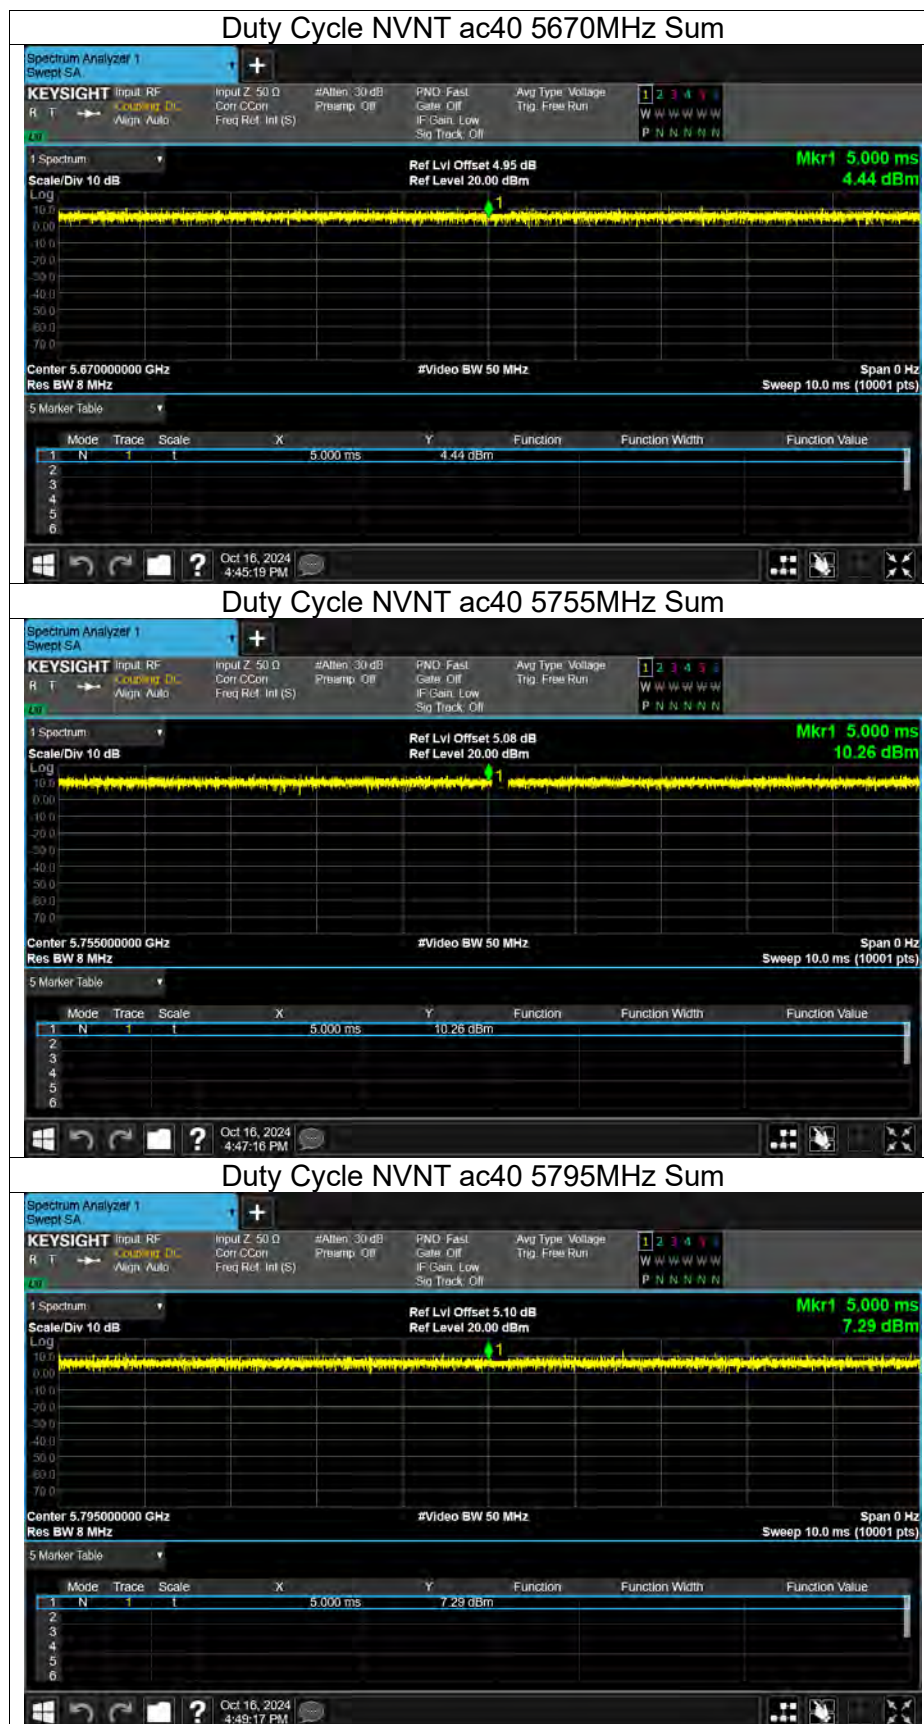


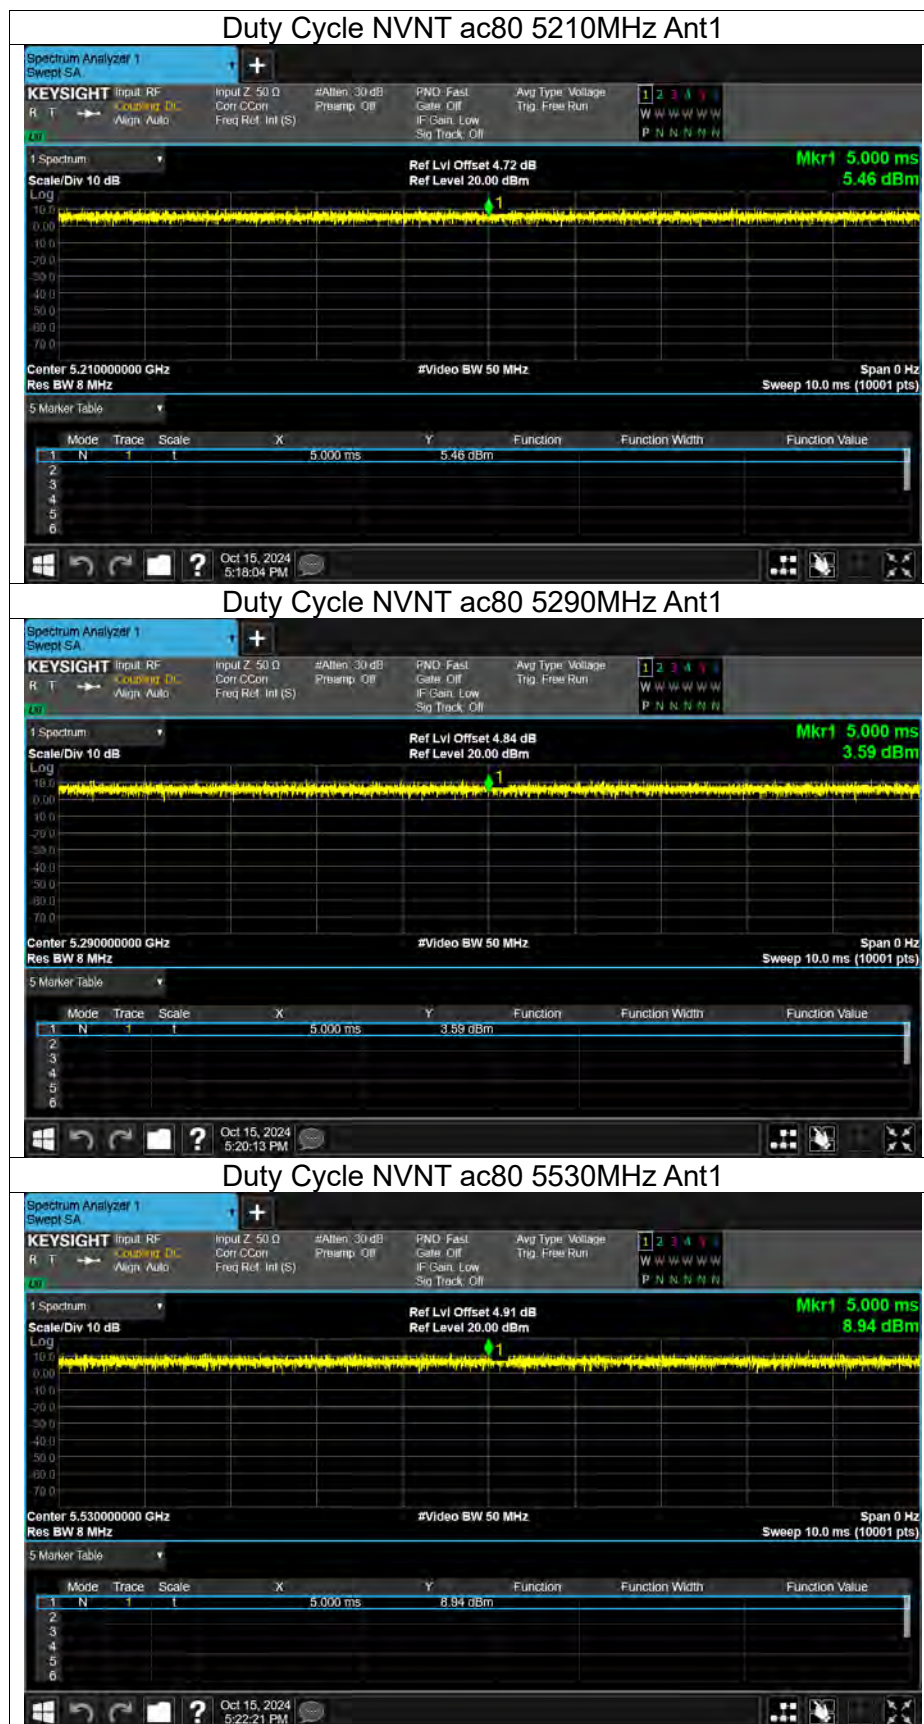


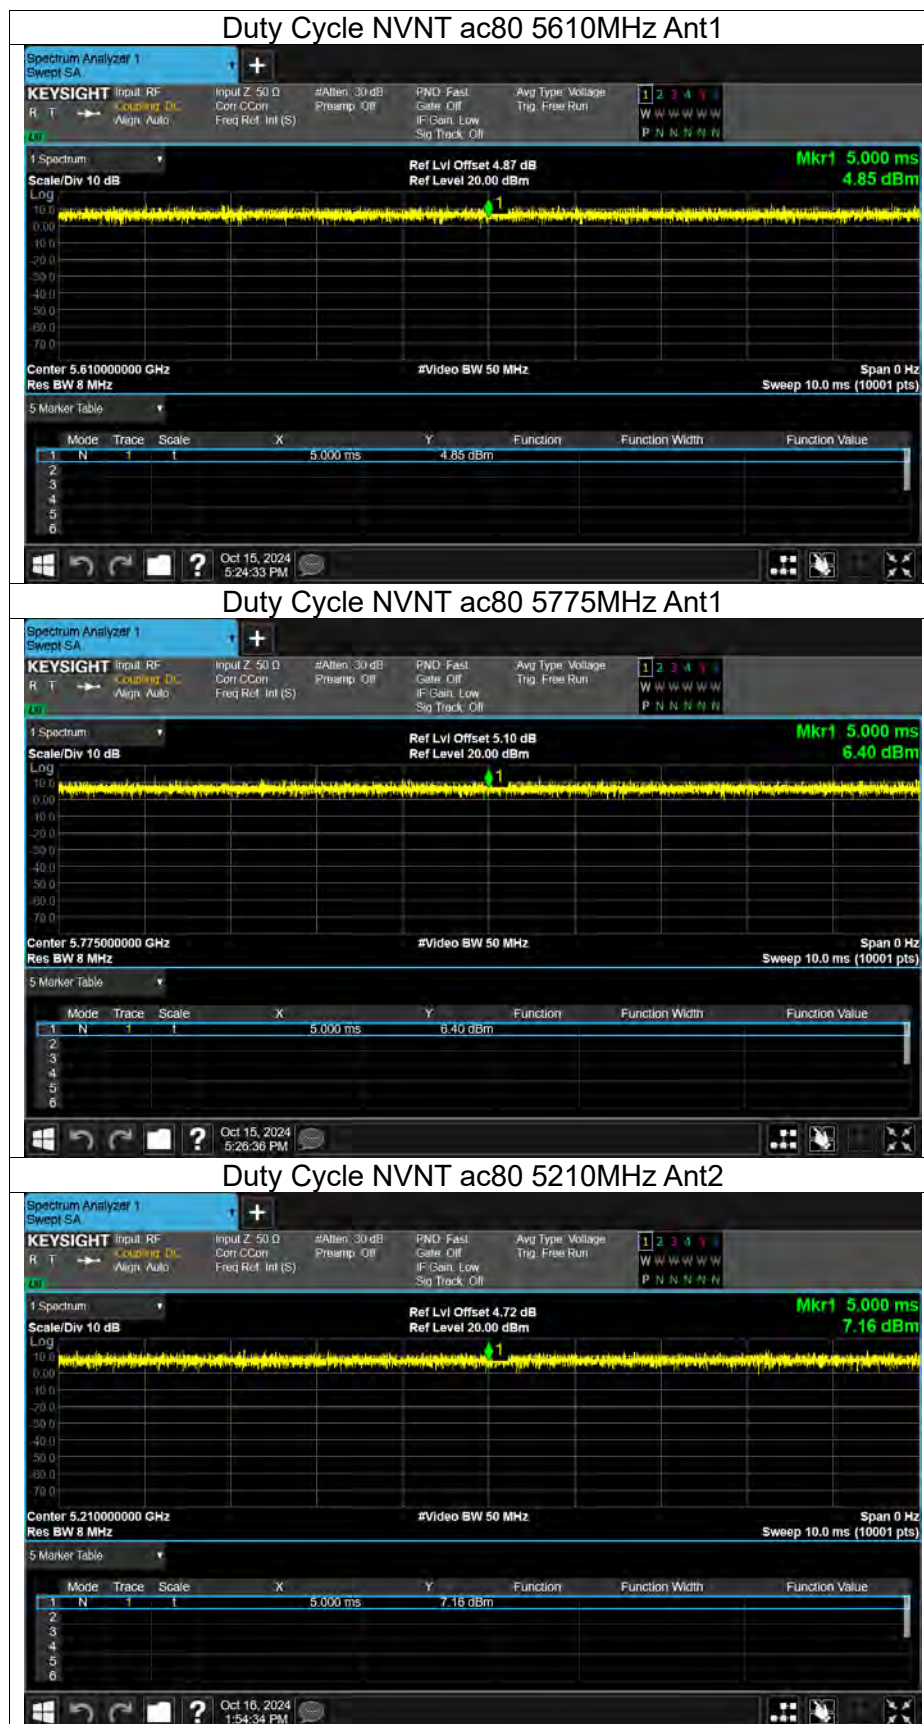





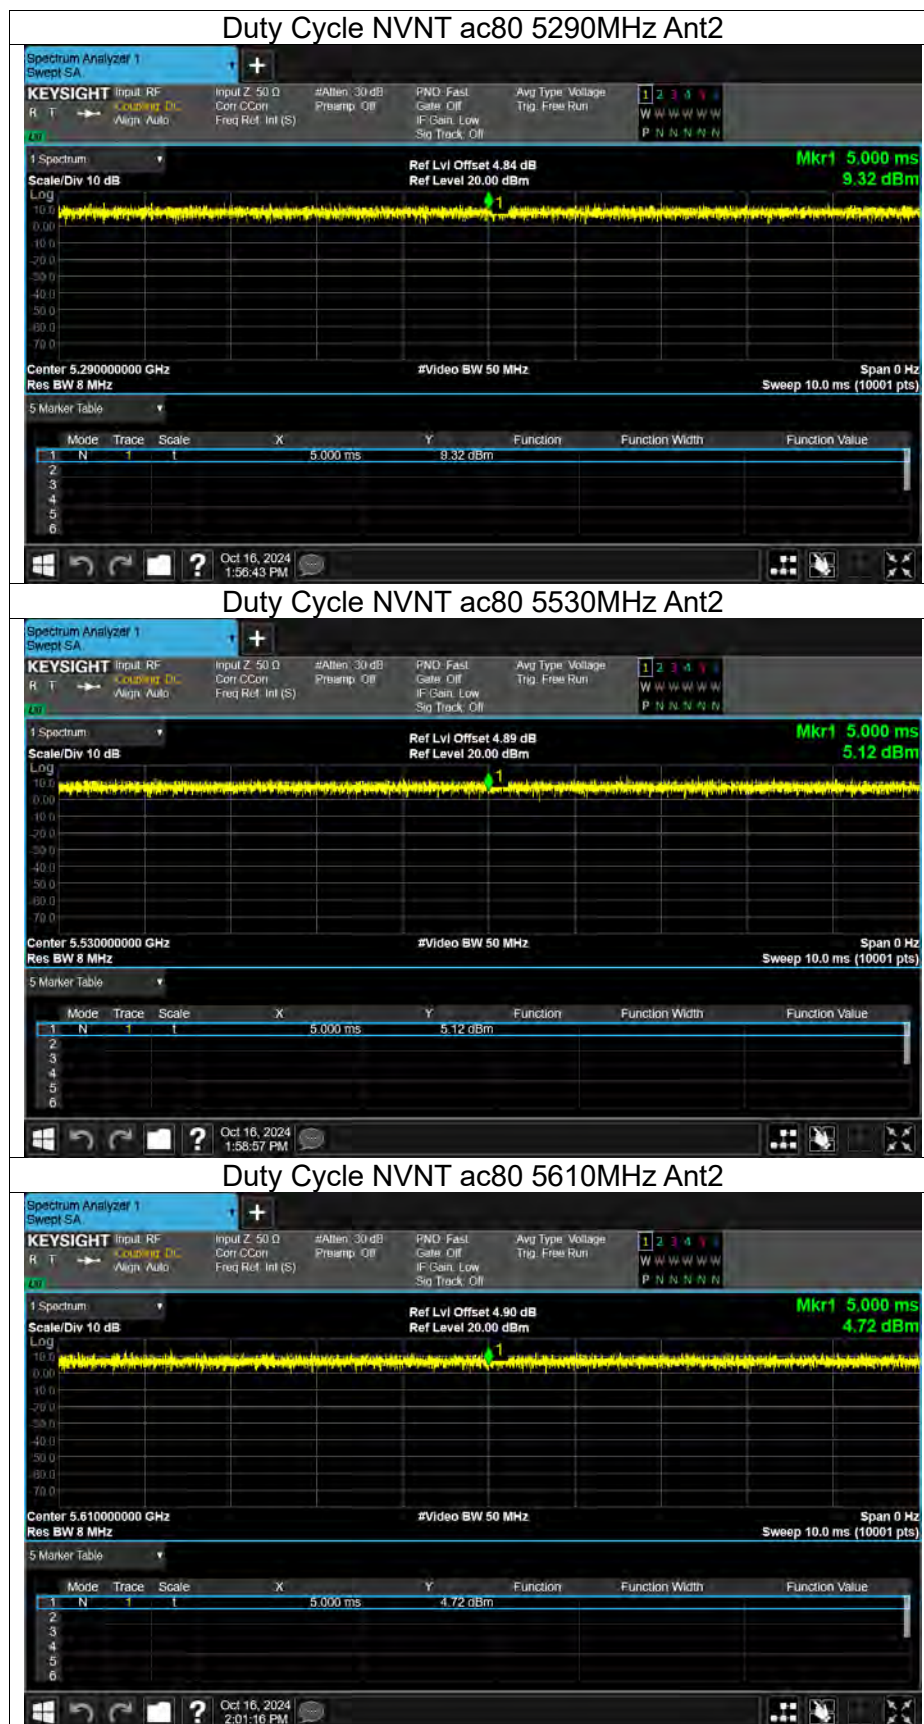


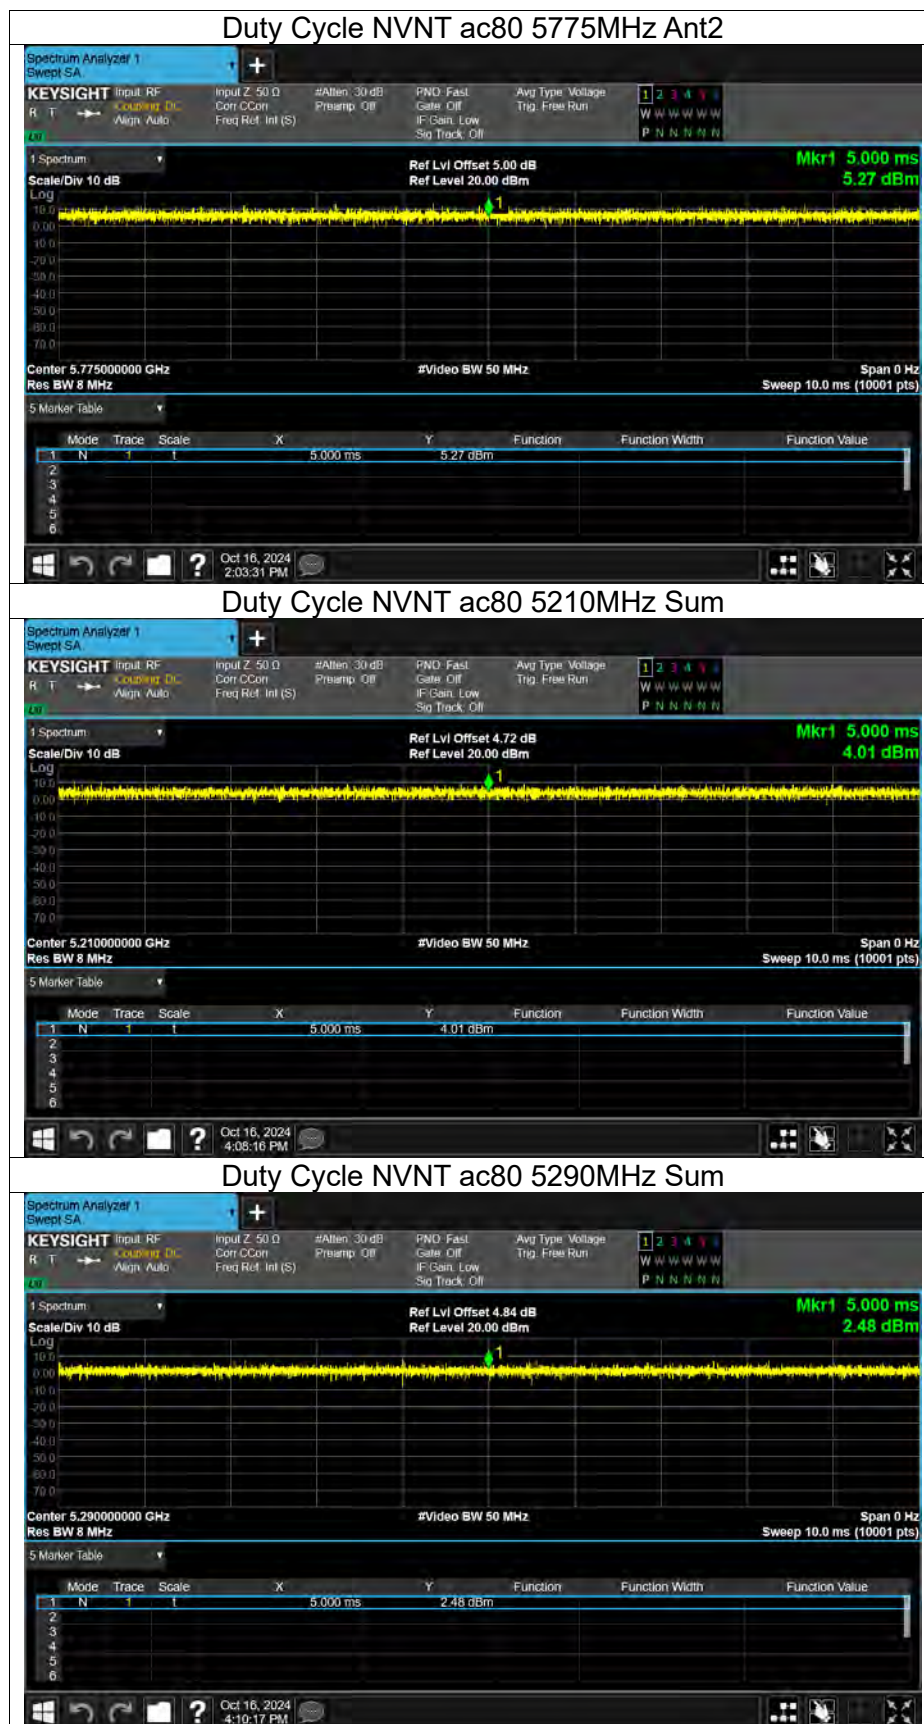


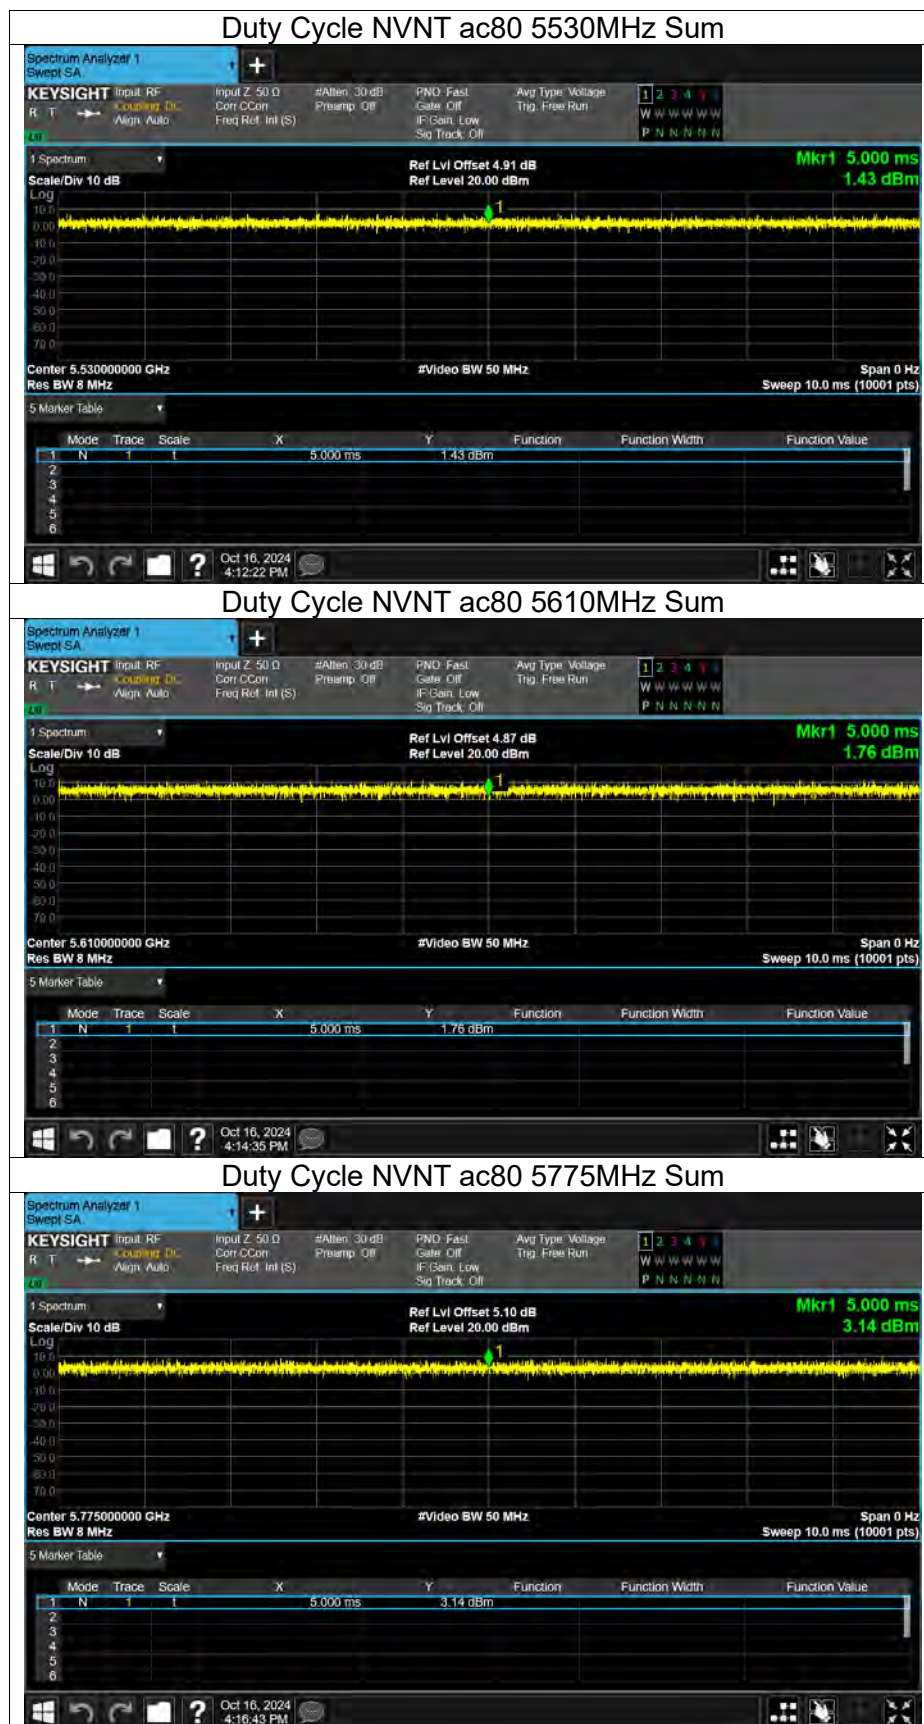

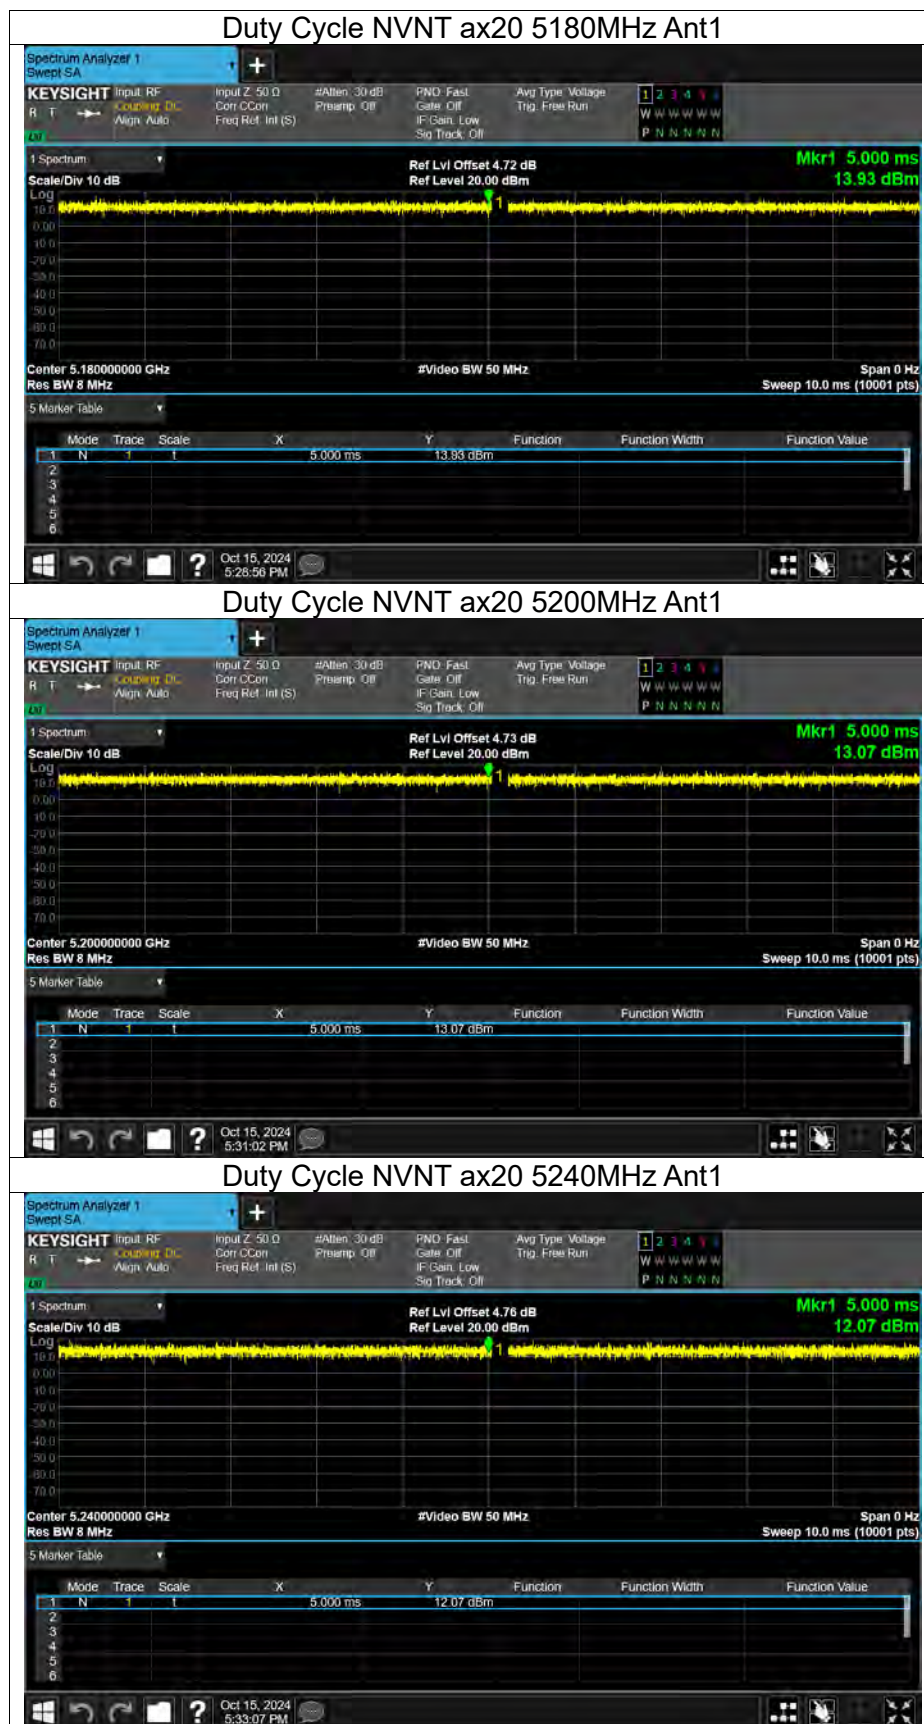

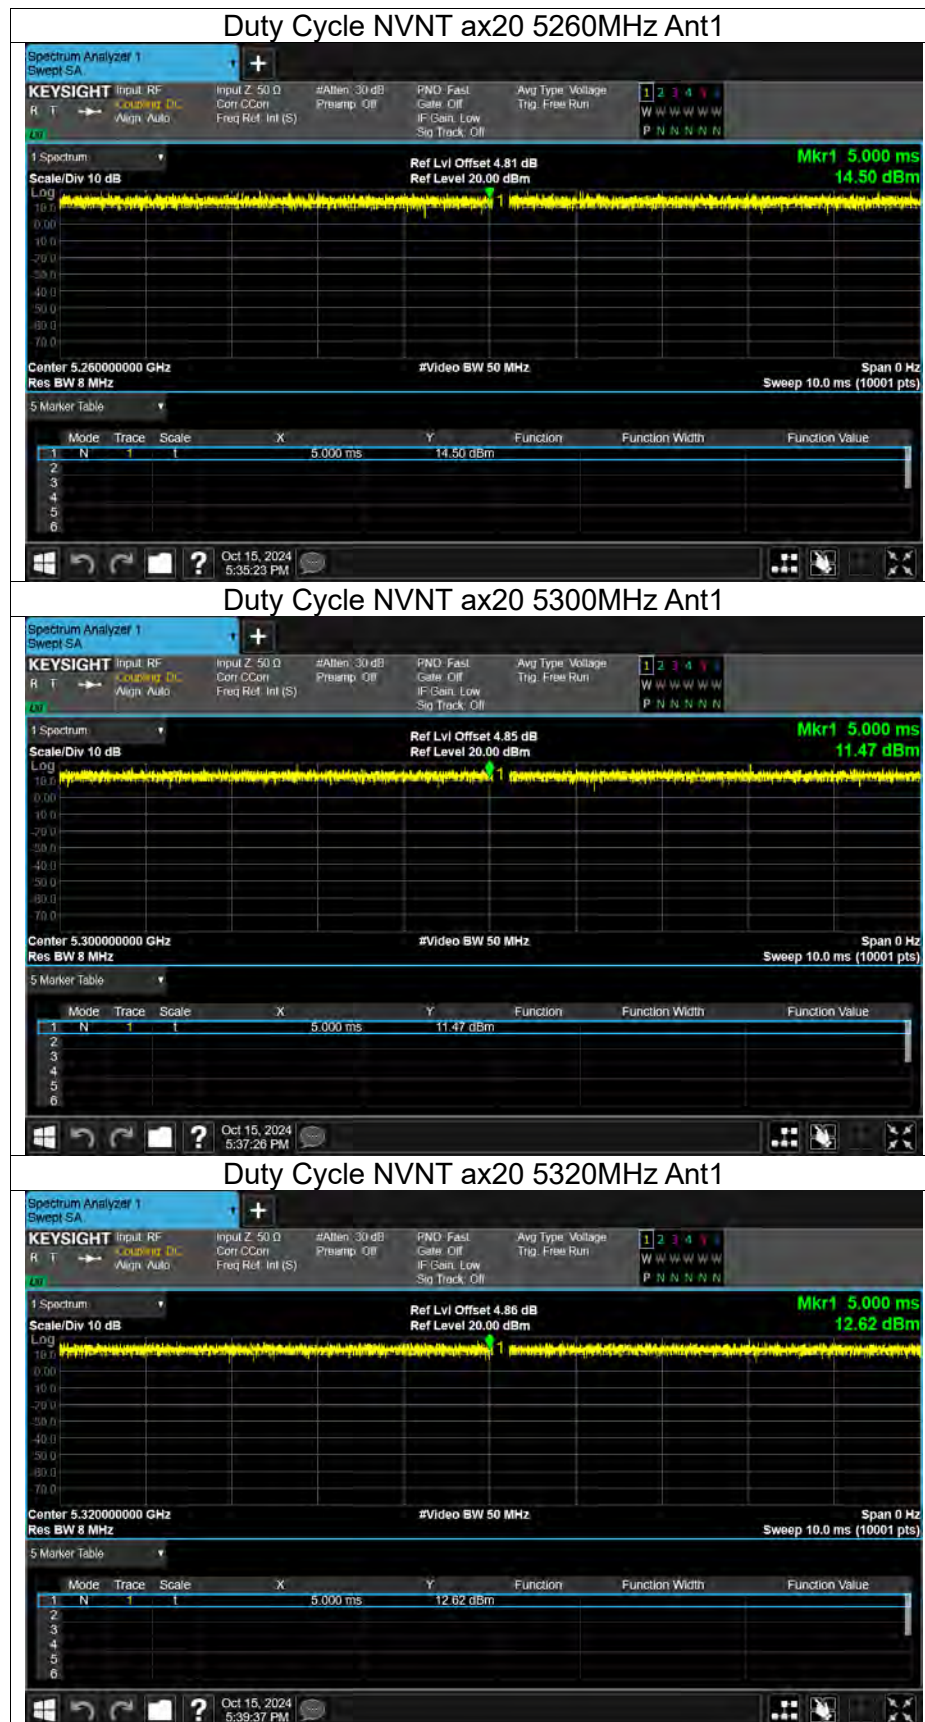


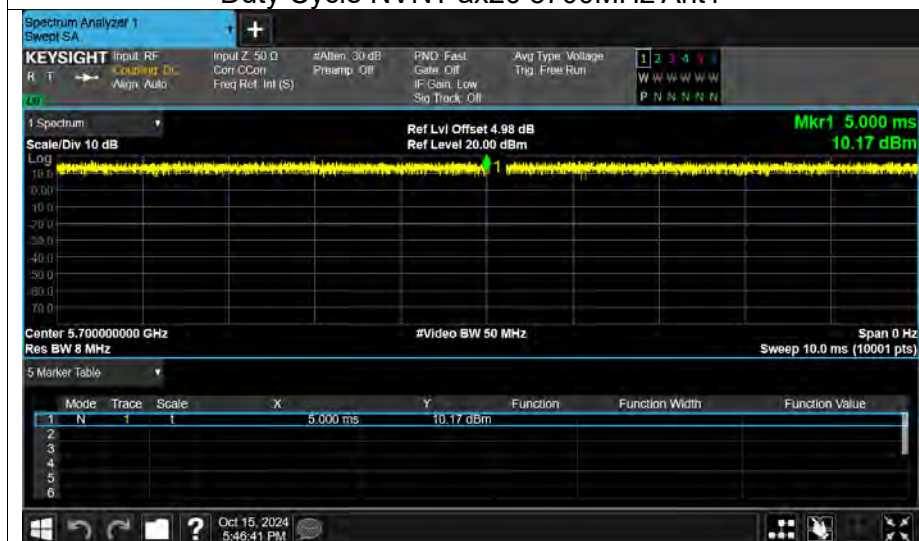

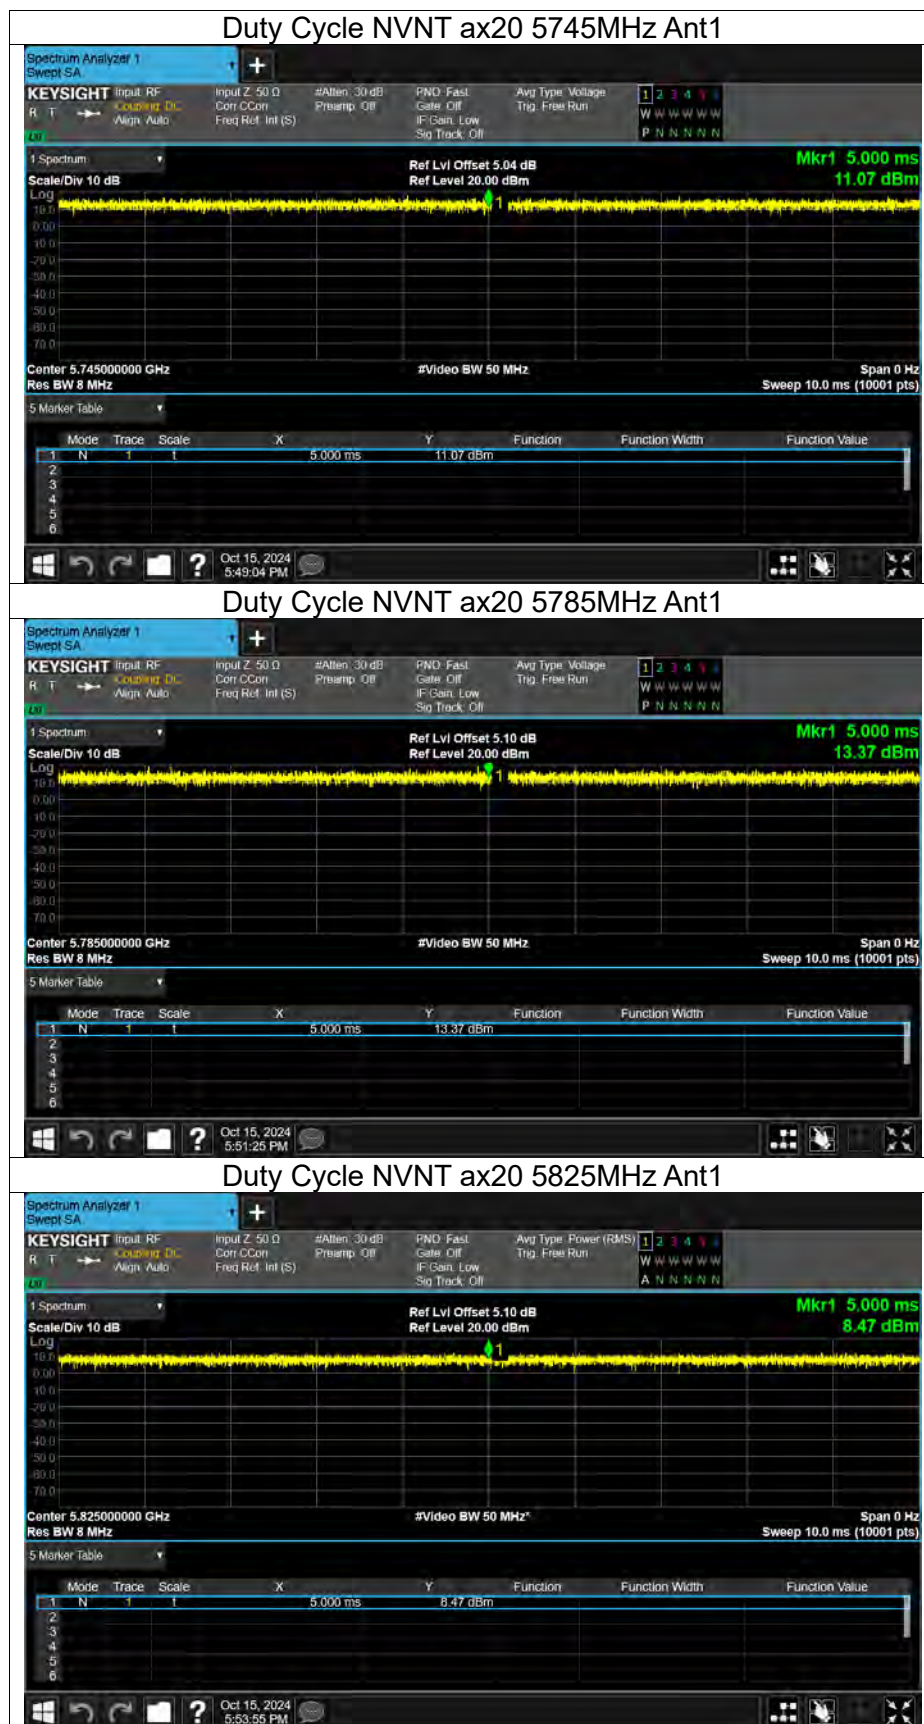




Duty Cycle NVNT ax20 5180MHz Ant2

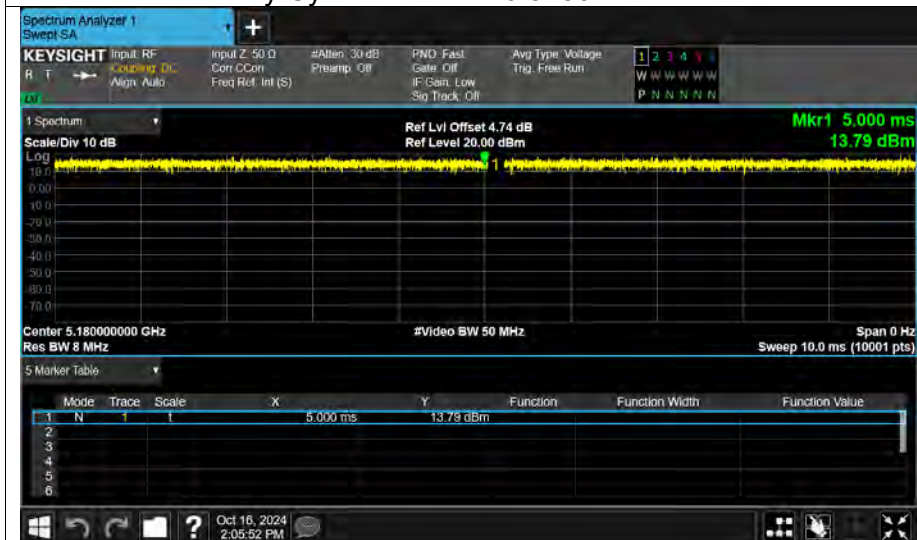


Duty Cycle NVNT ax20 5200MHz Ant2

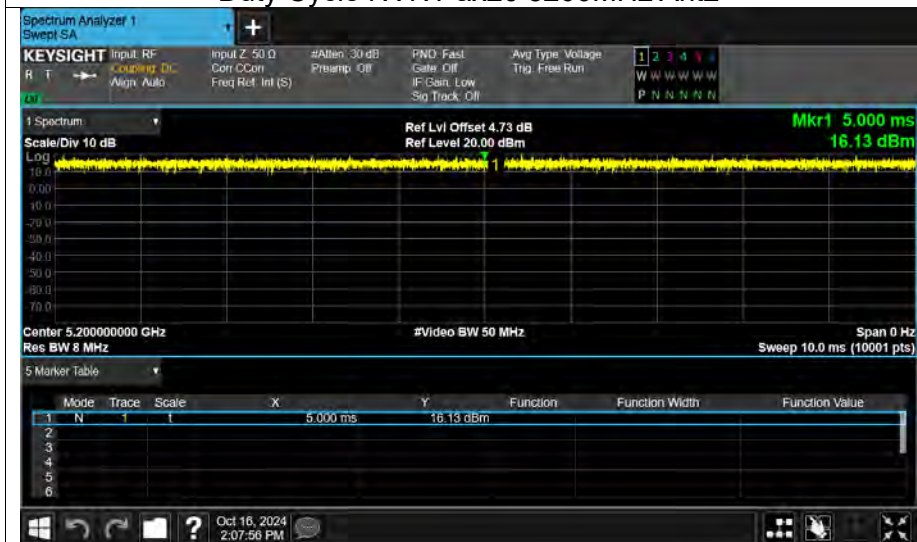



Duty Cycle NVNT ax20 5240MHz Ant2







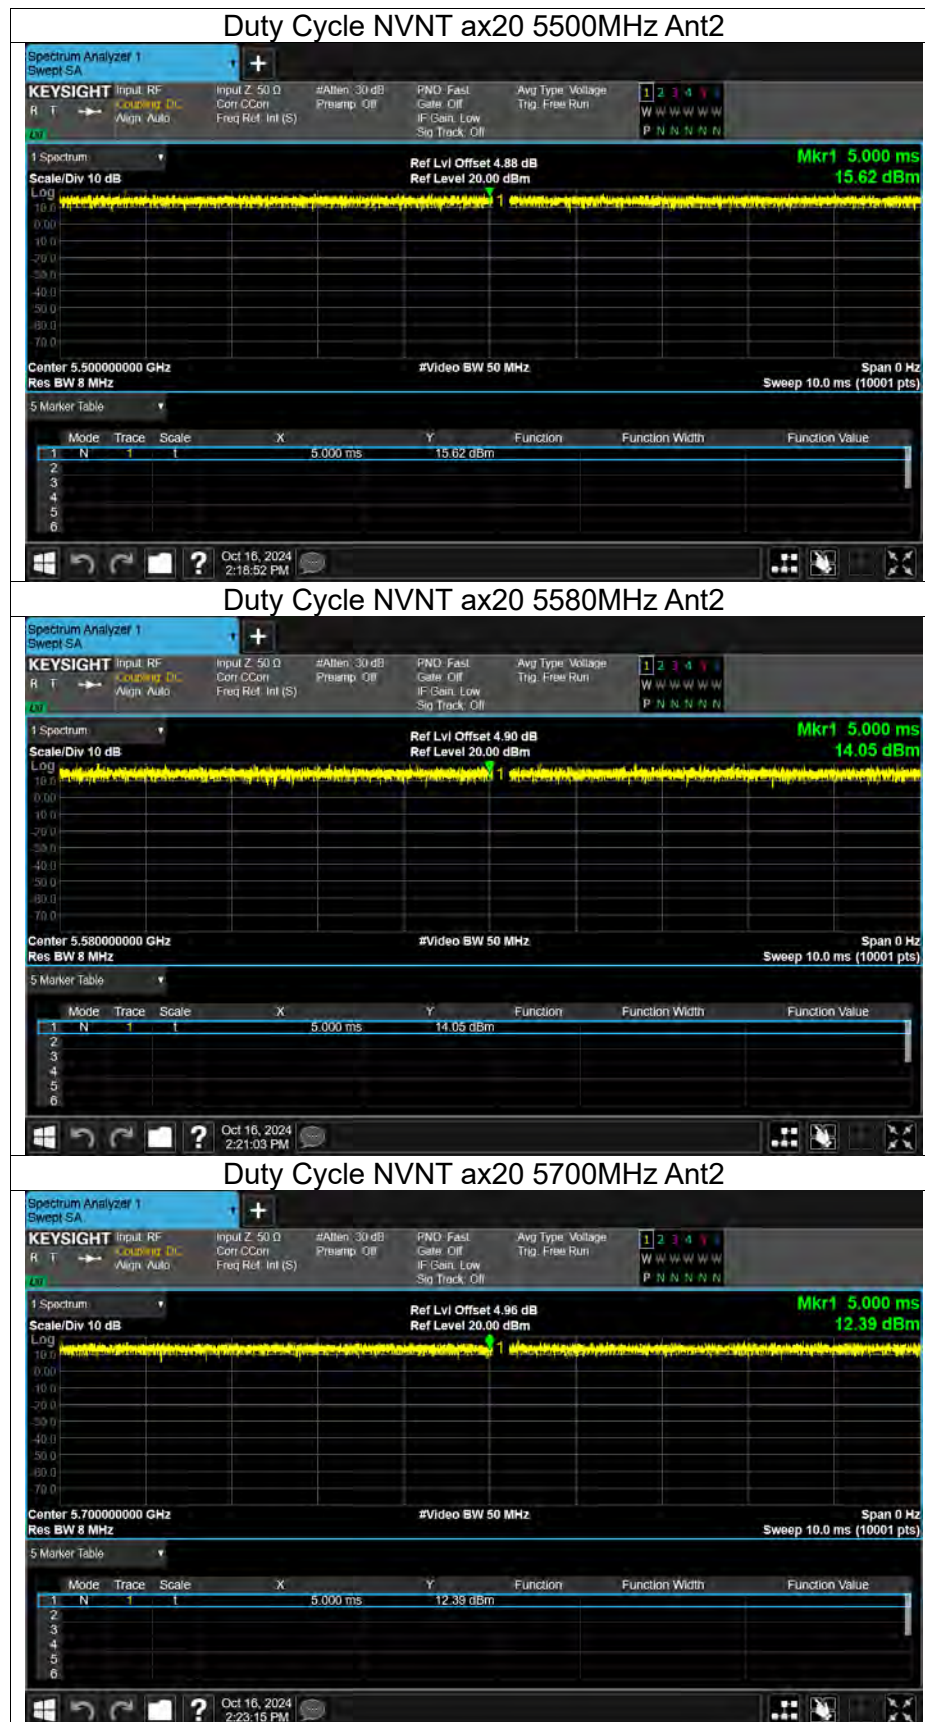


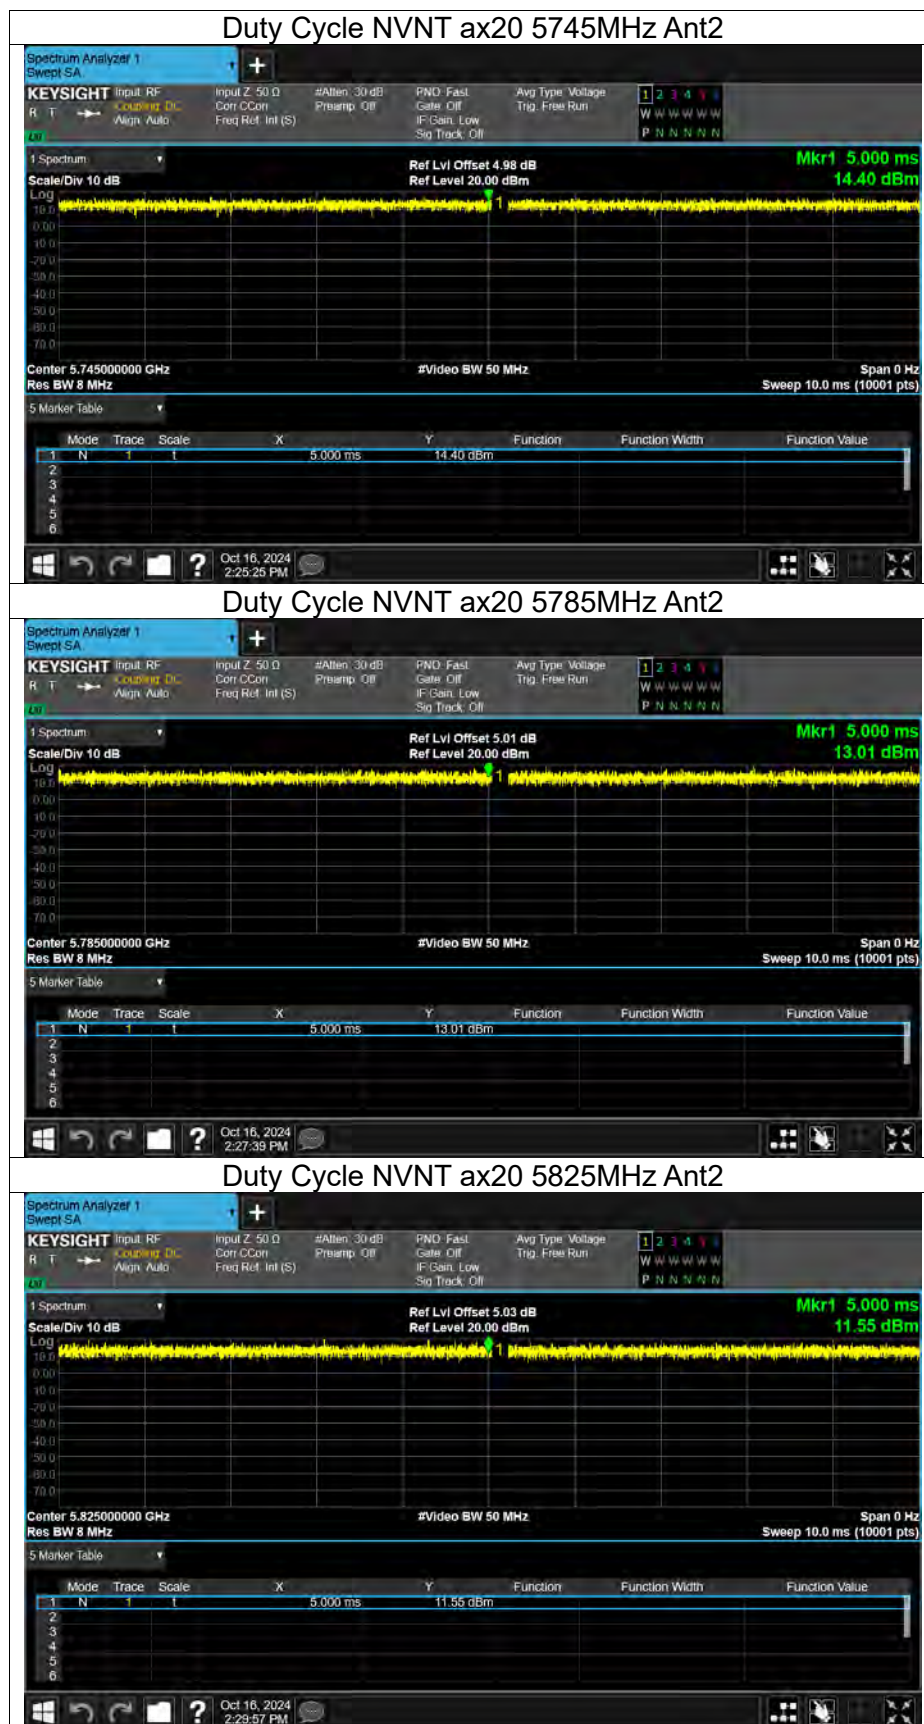


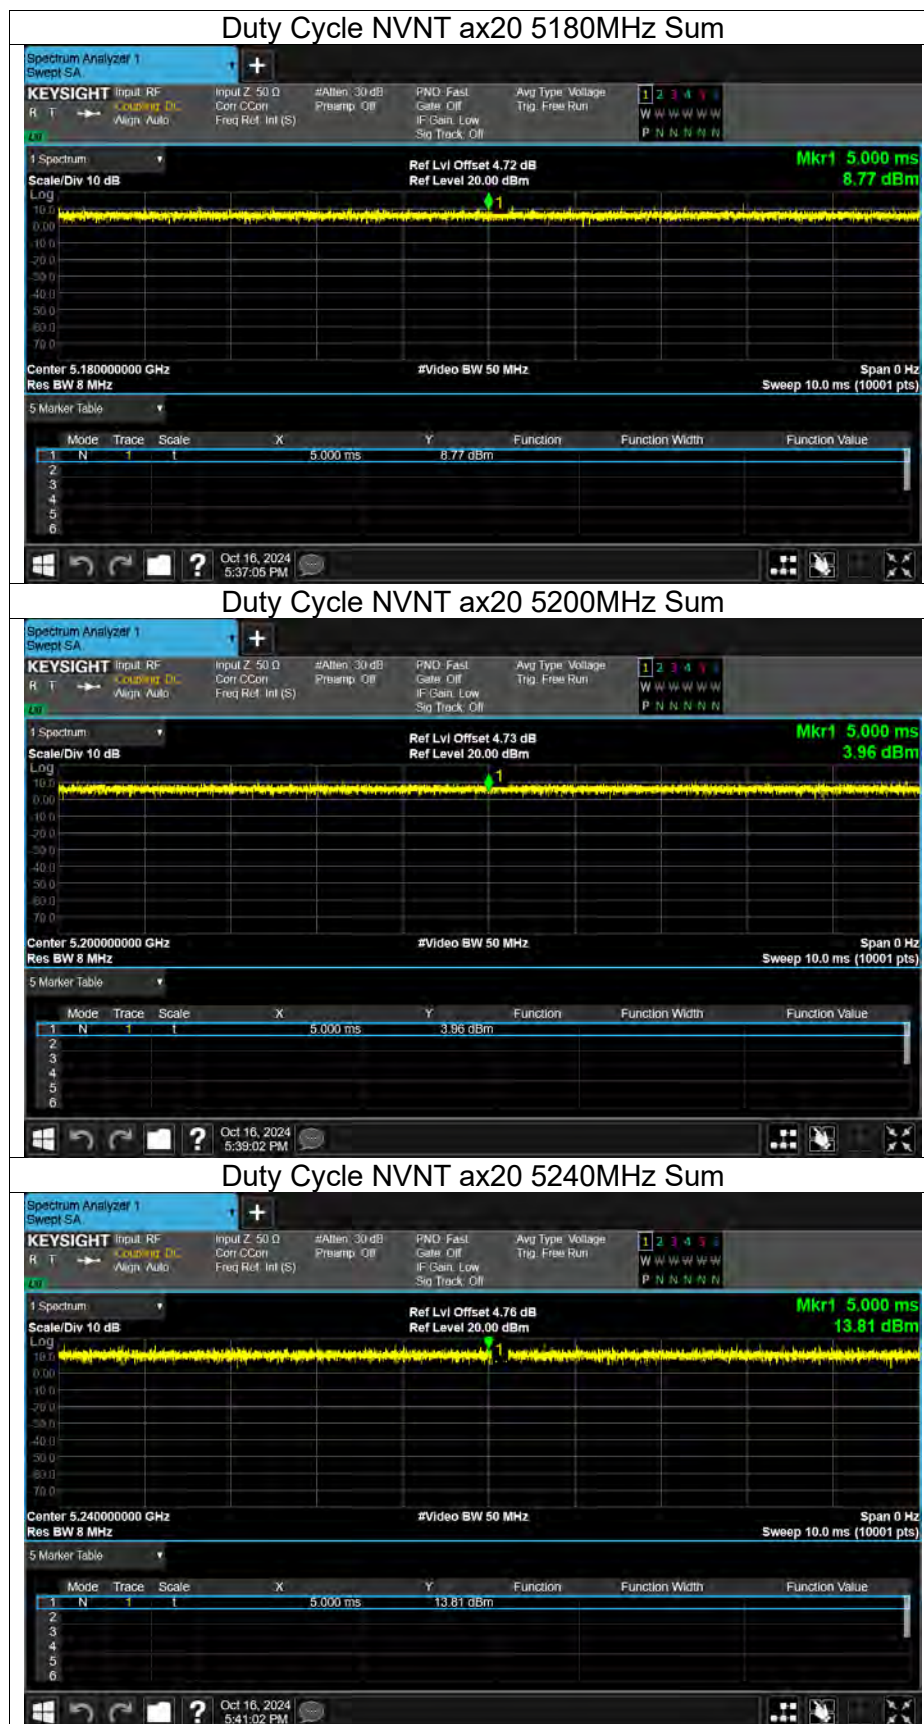

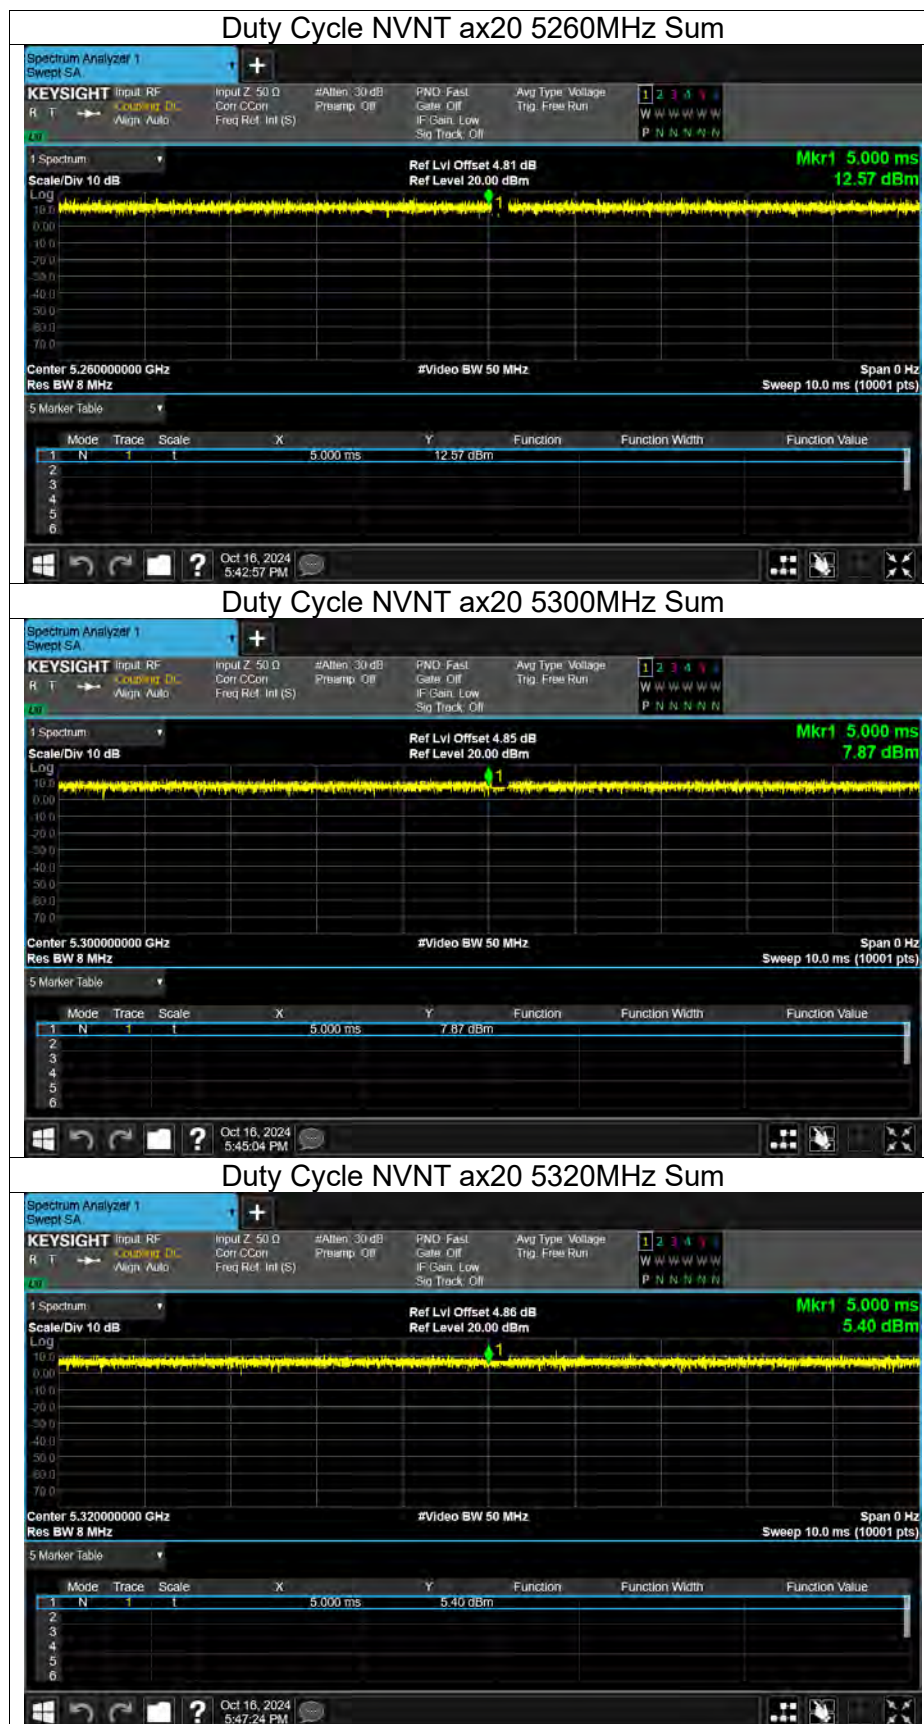

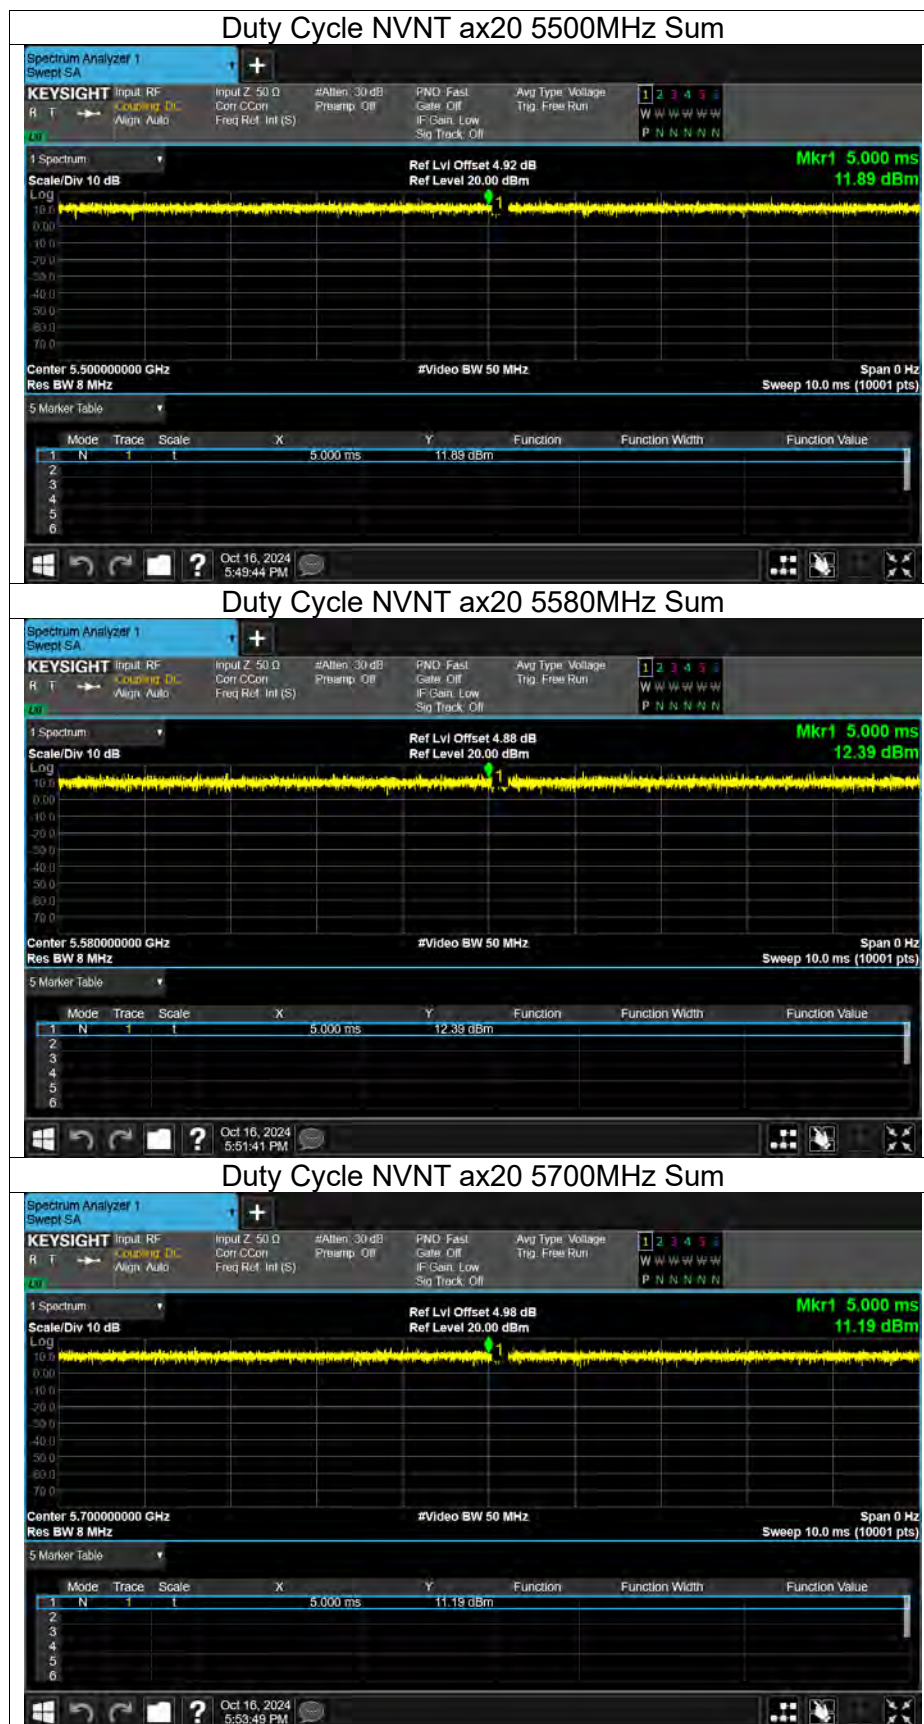


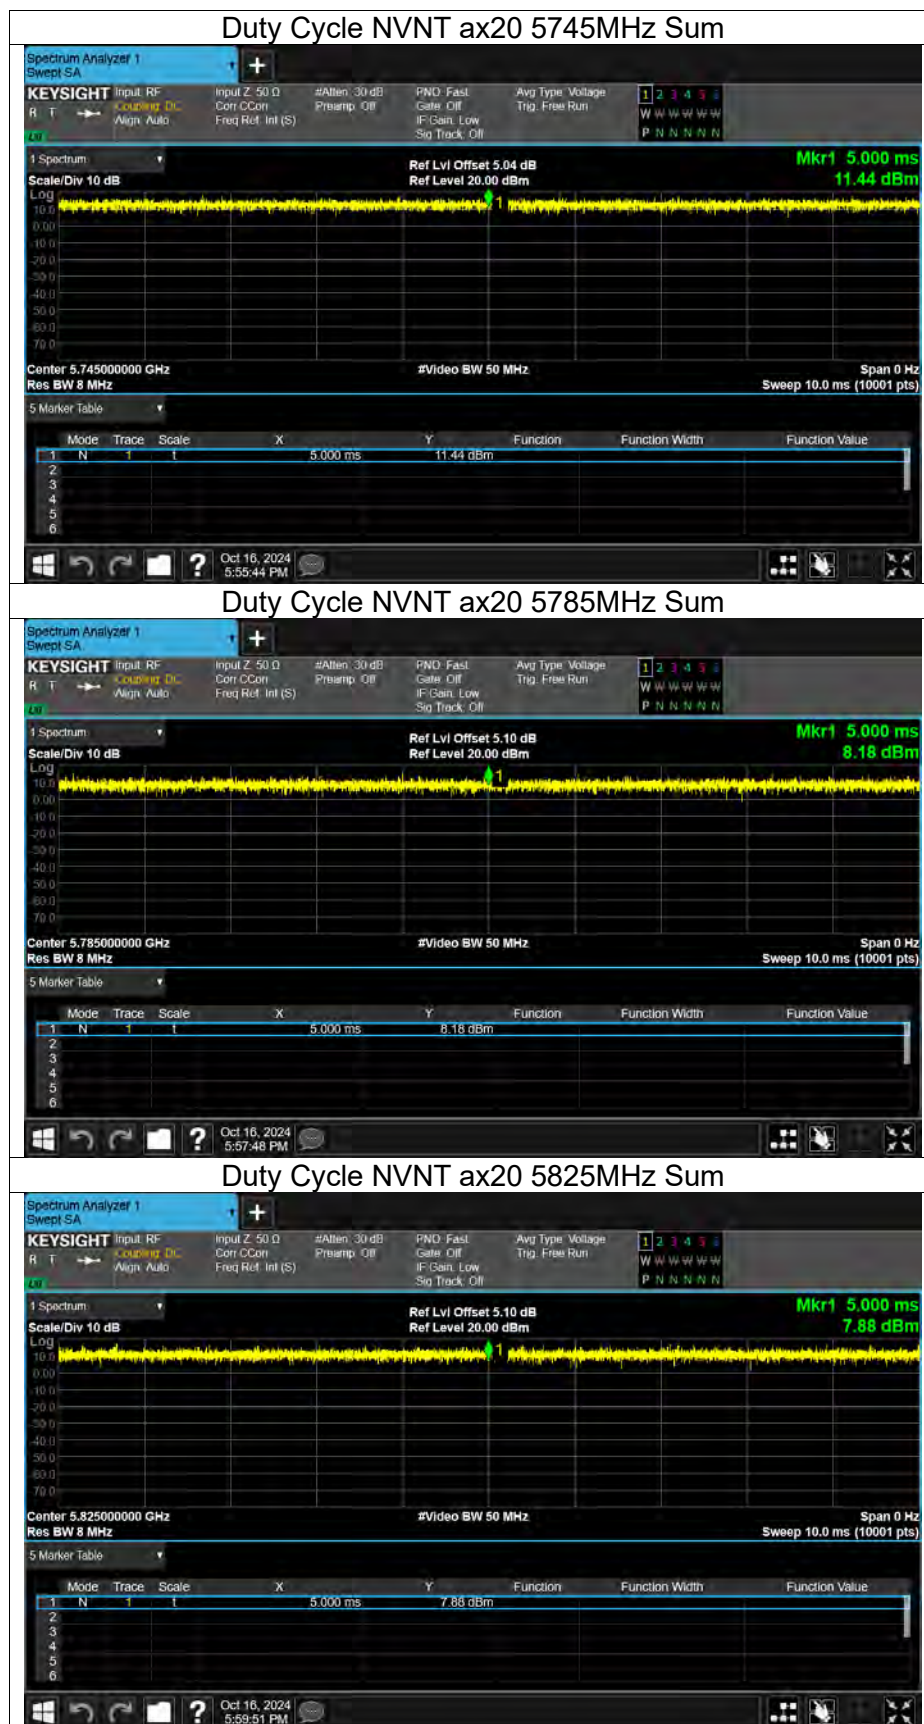

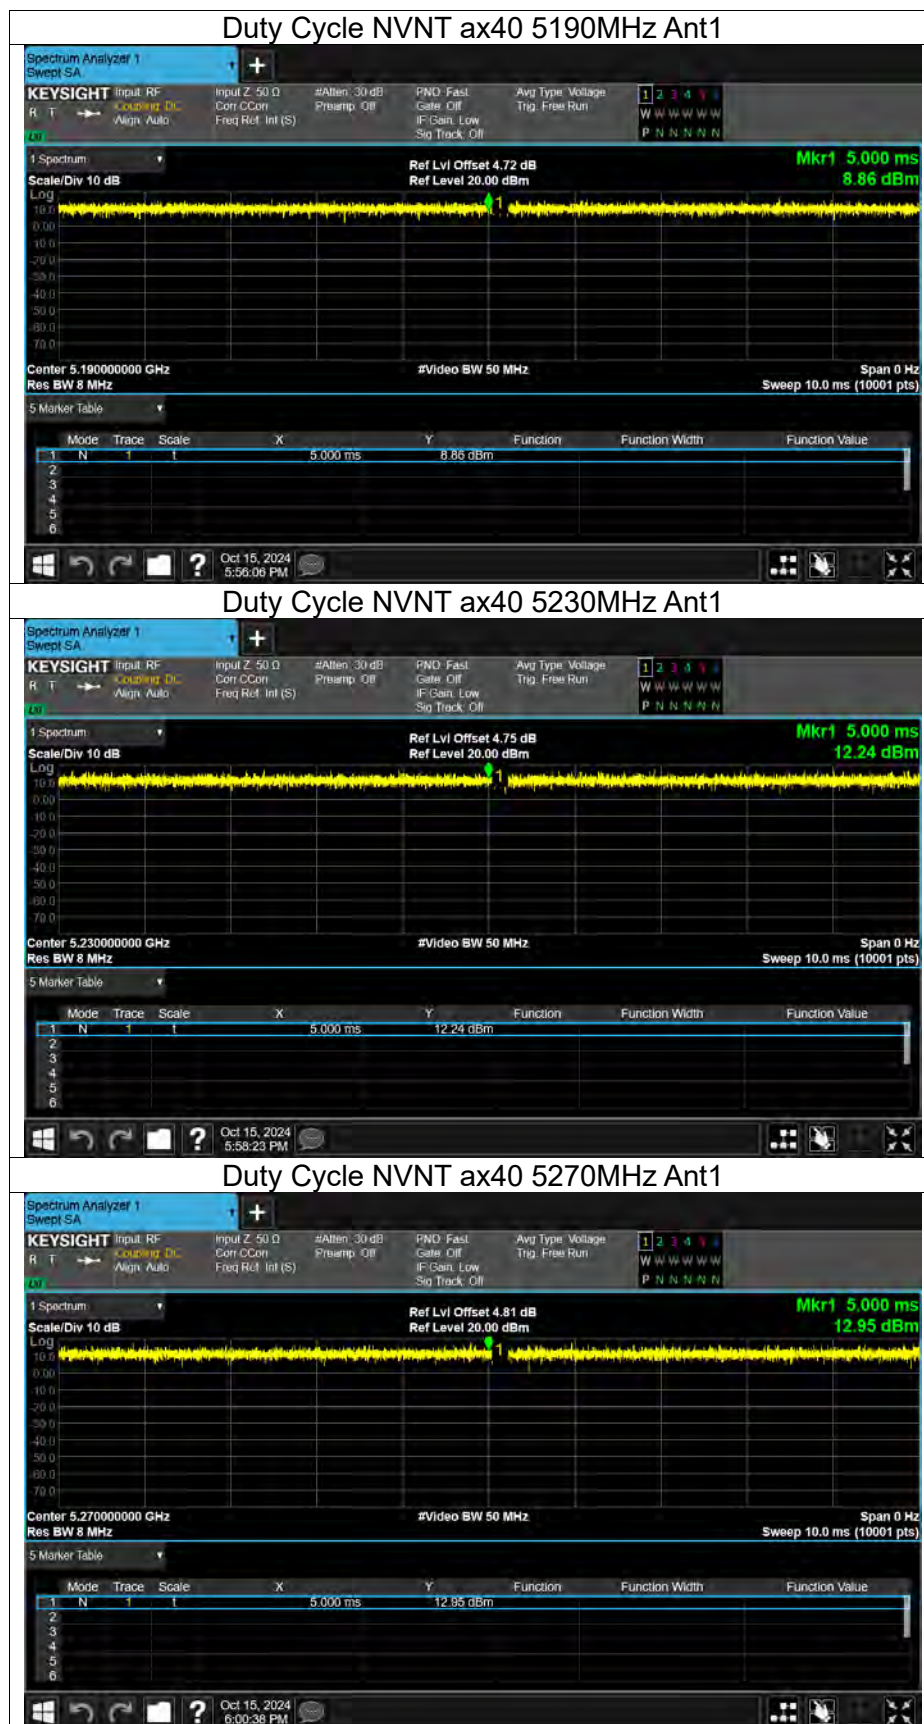





Duty Cycle NVNT ax40 5310MHz Ant1

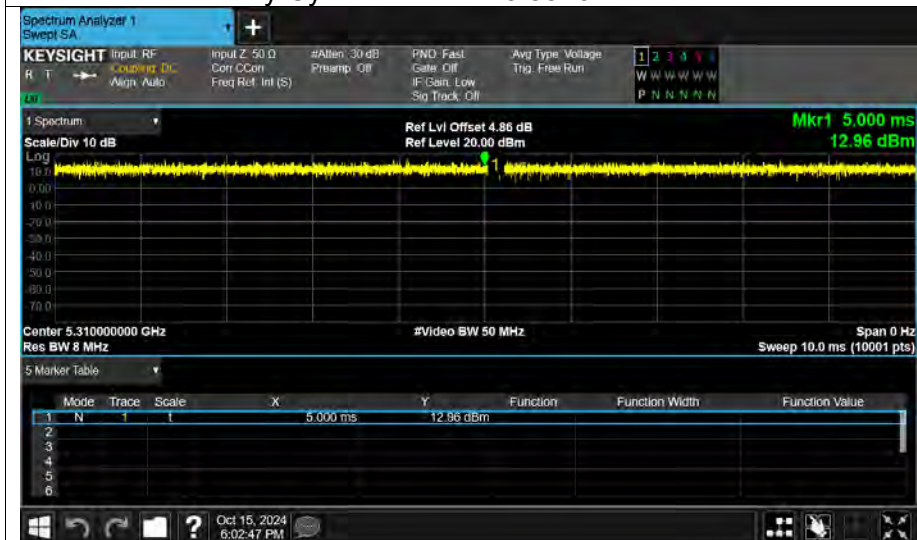


Duty Cycle NVNT ax40 5510MHz Ant1

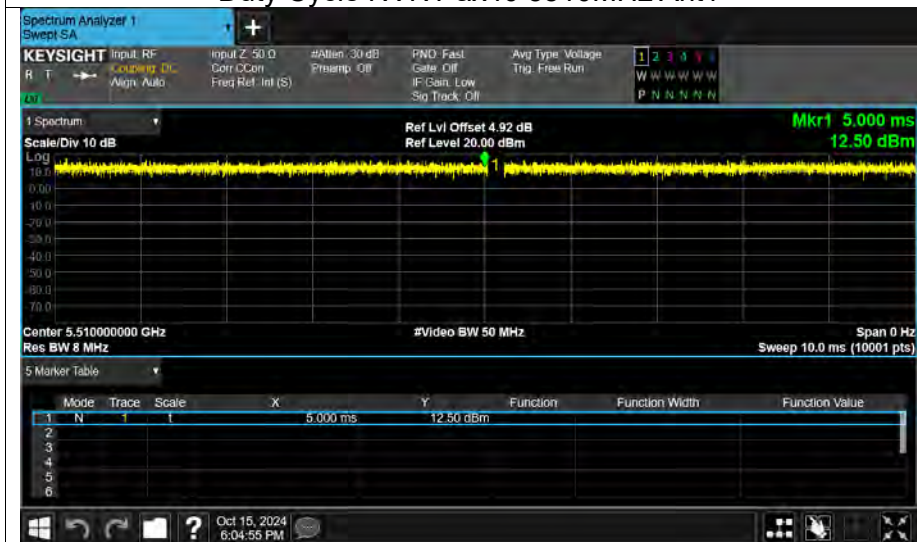

Duty Cycle NVNT ax40 5550MHz Ant1

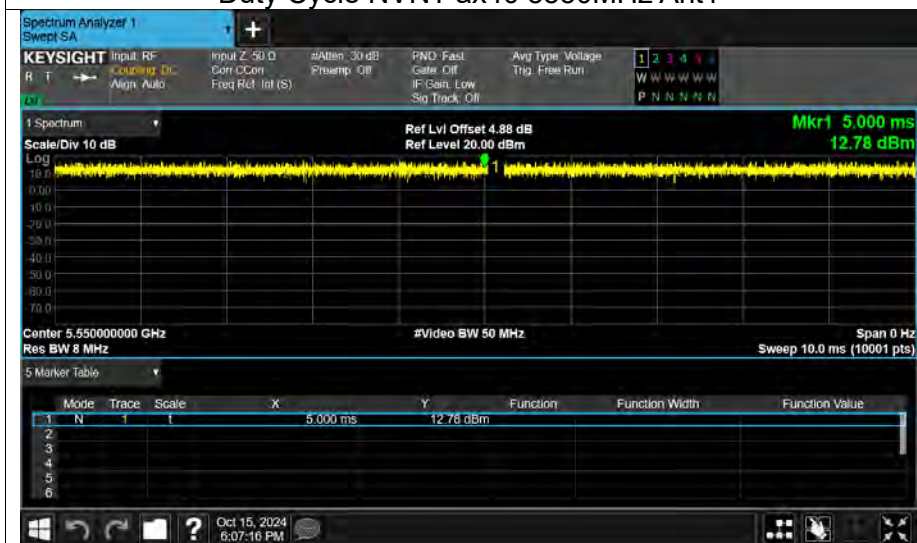

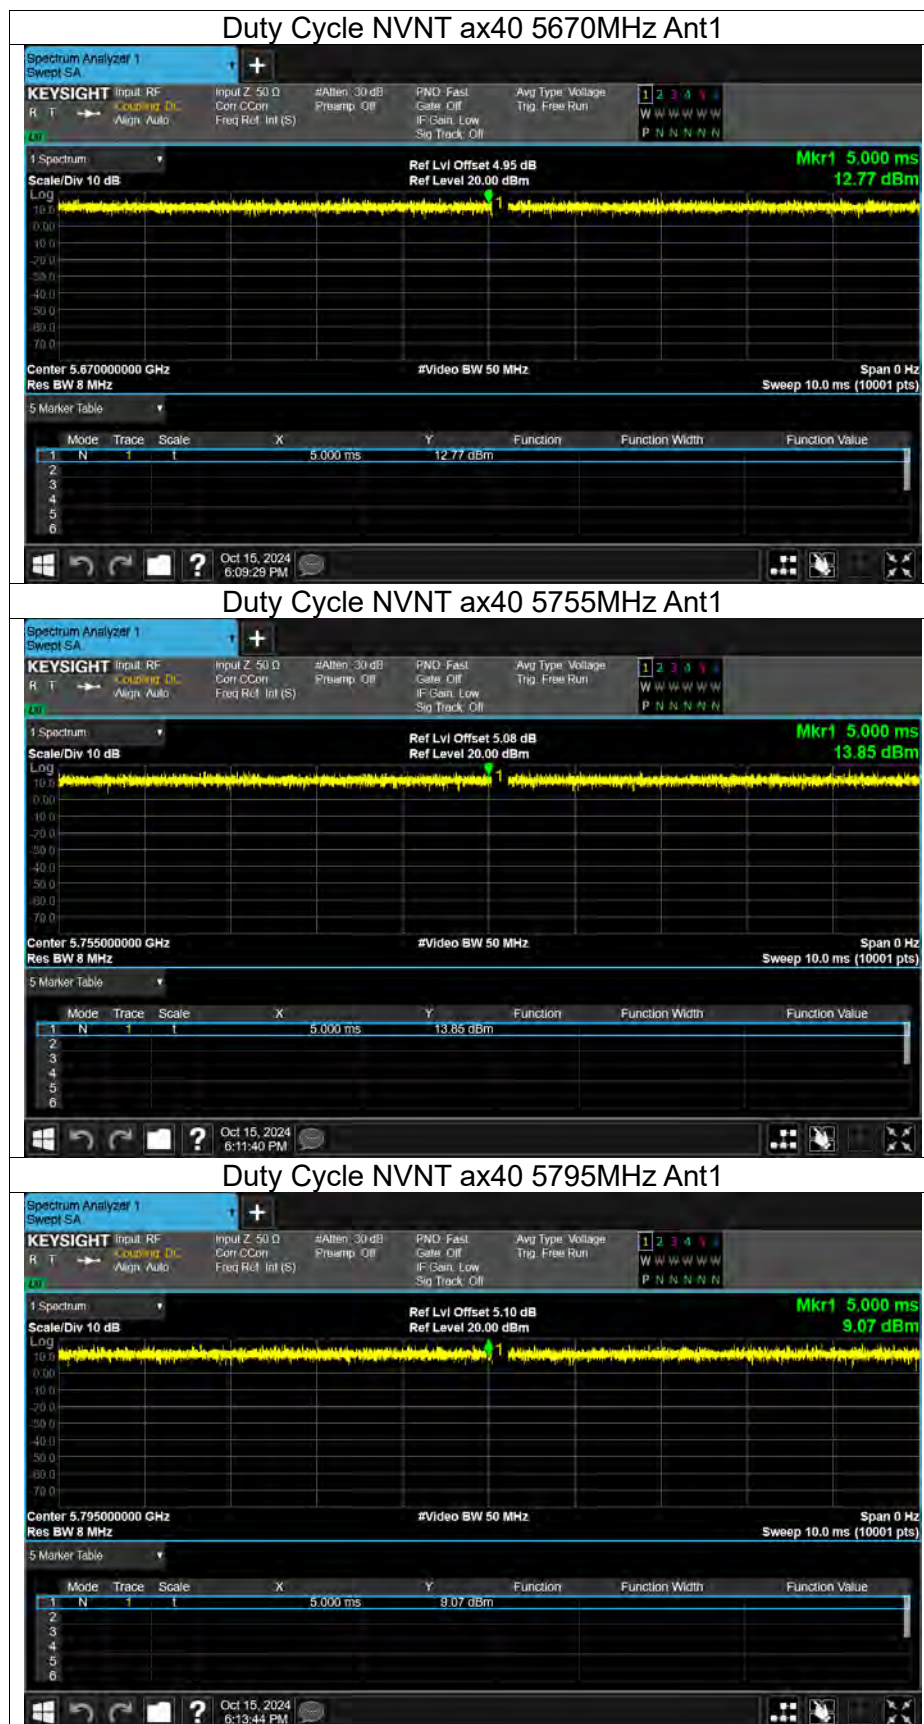







Duty Cycle NVNT ax40 5310MHz Ant2





Duty Cycle NVNT ax40 5510MHz Ant2

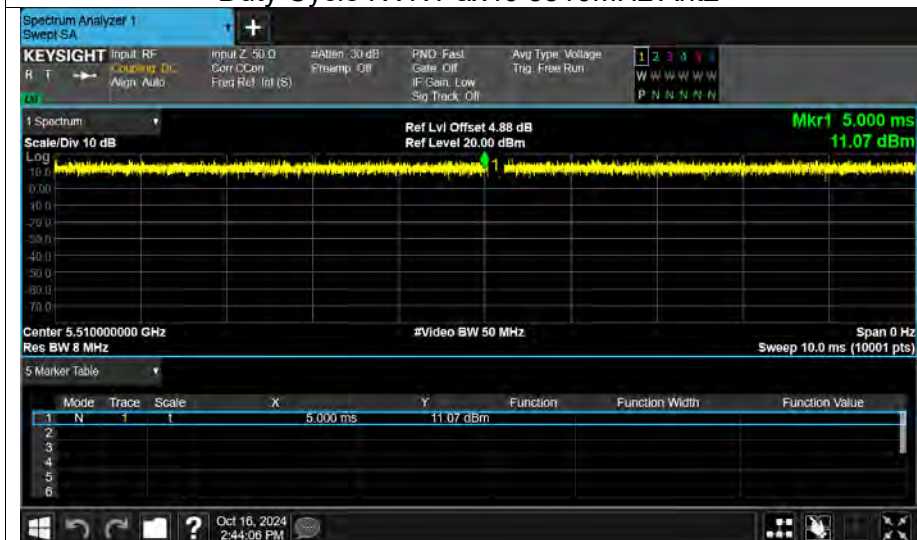



Duty Cycle NVNT ax40 5550MHz Ant2

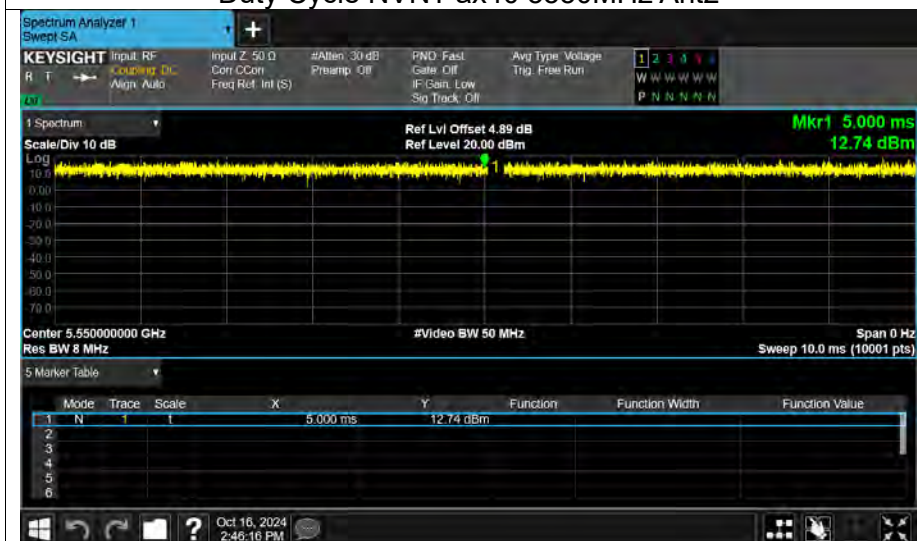


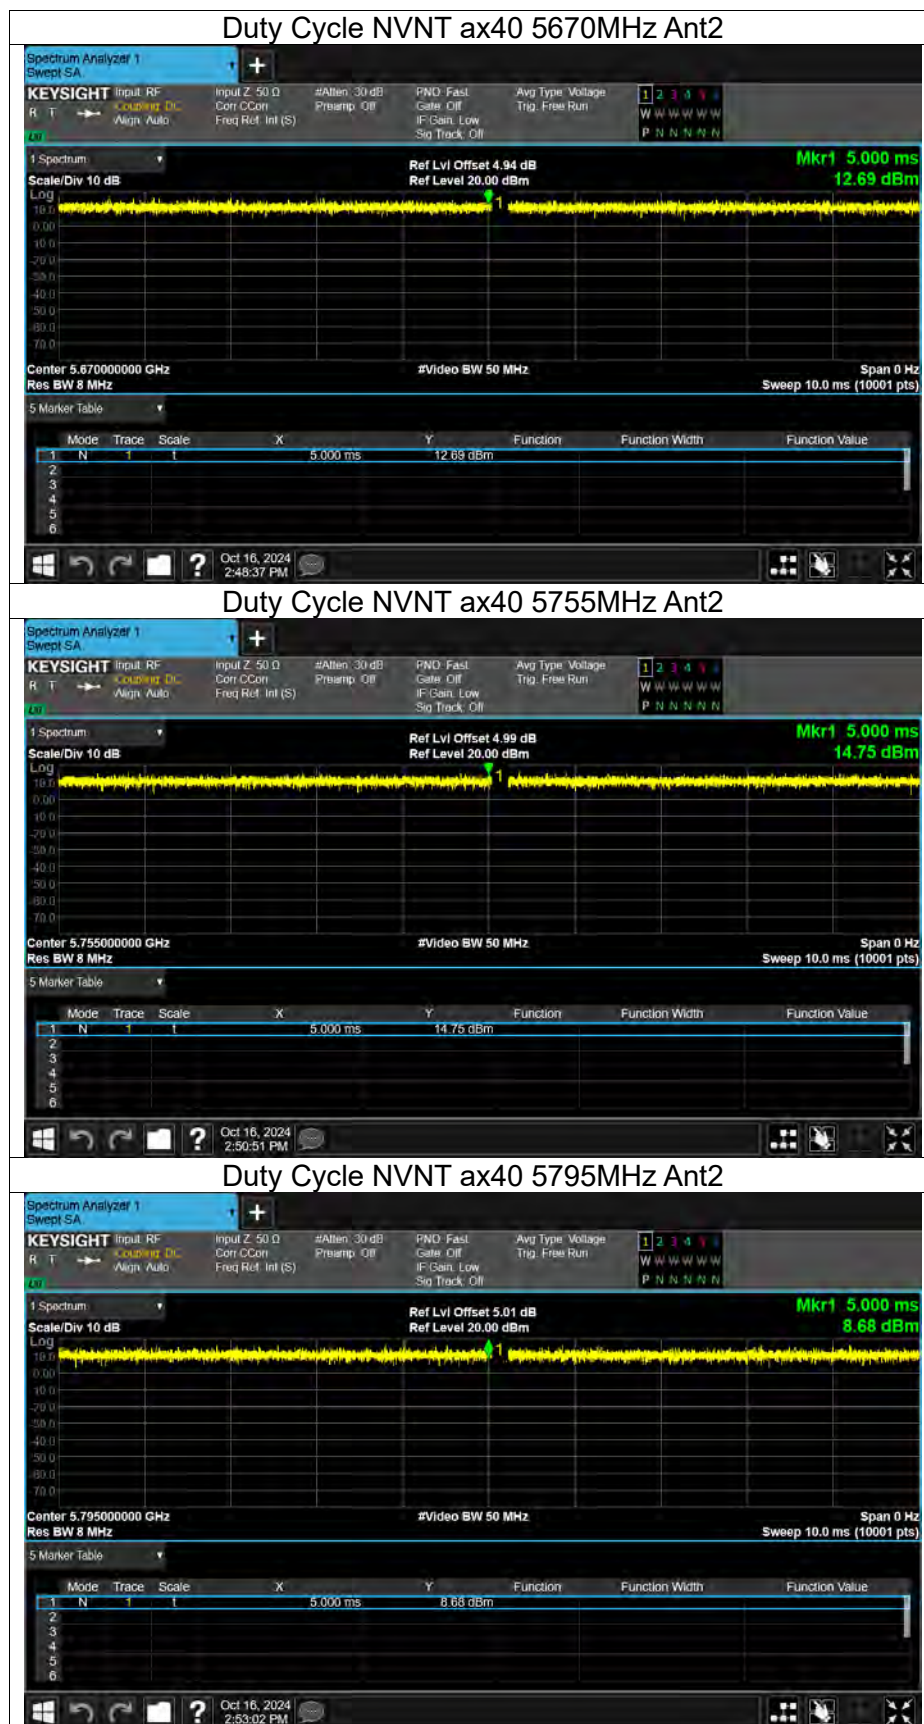


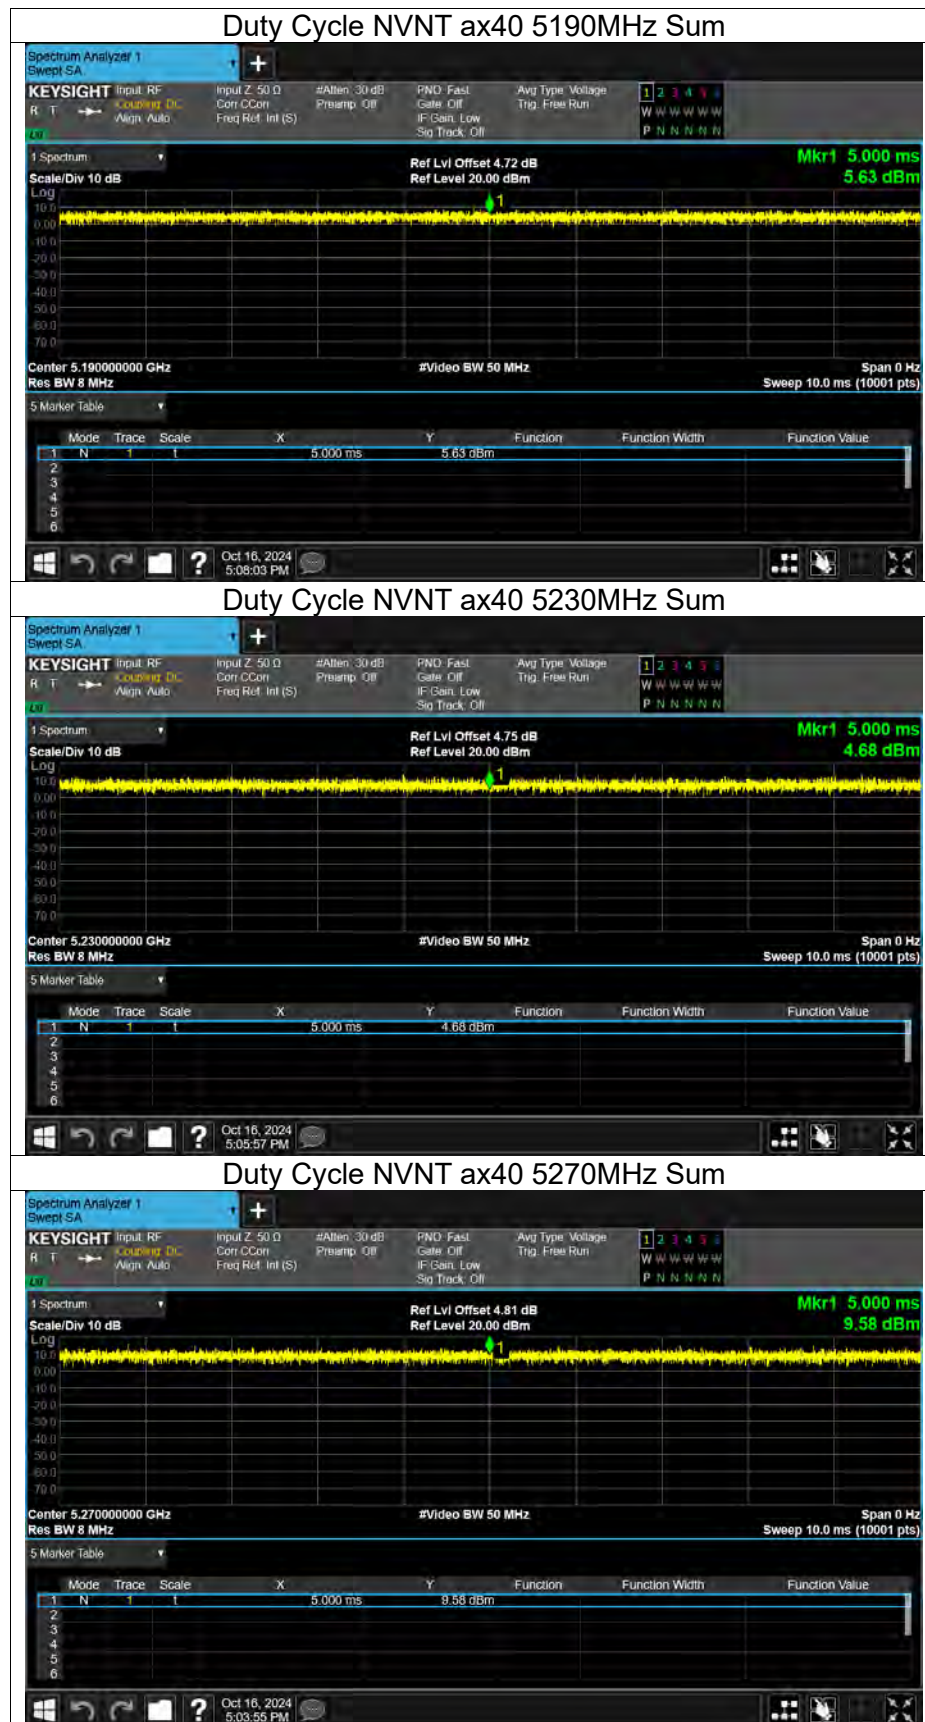


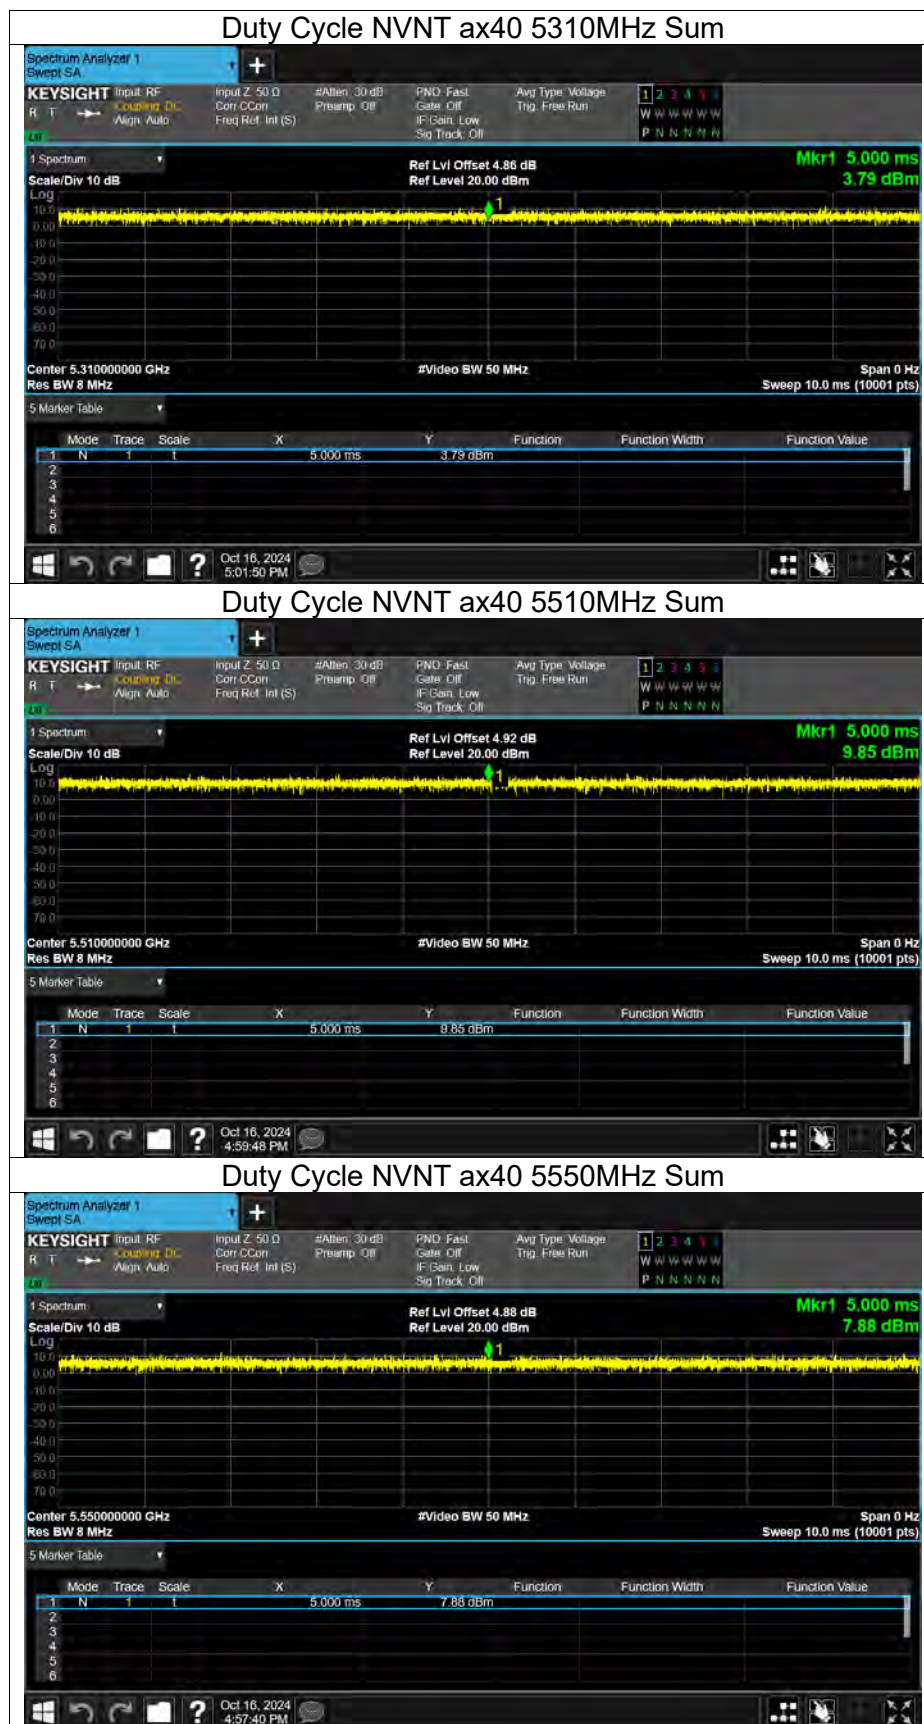


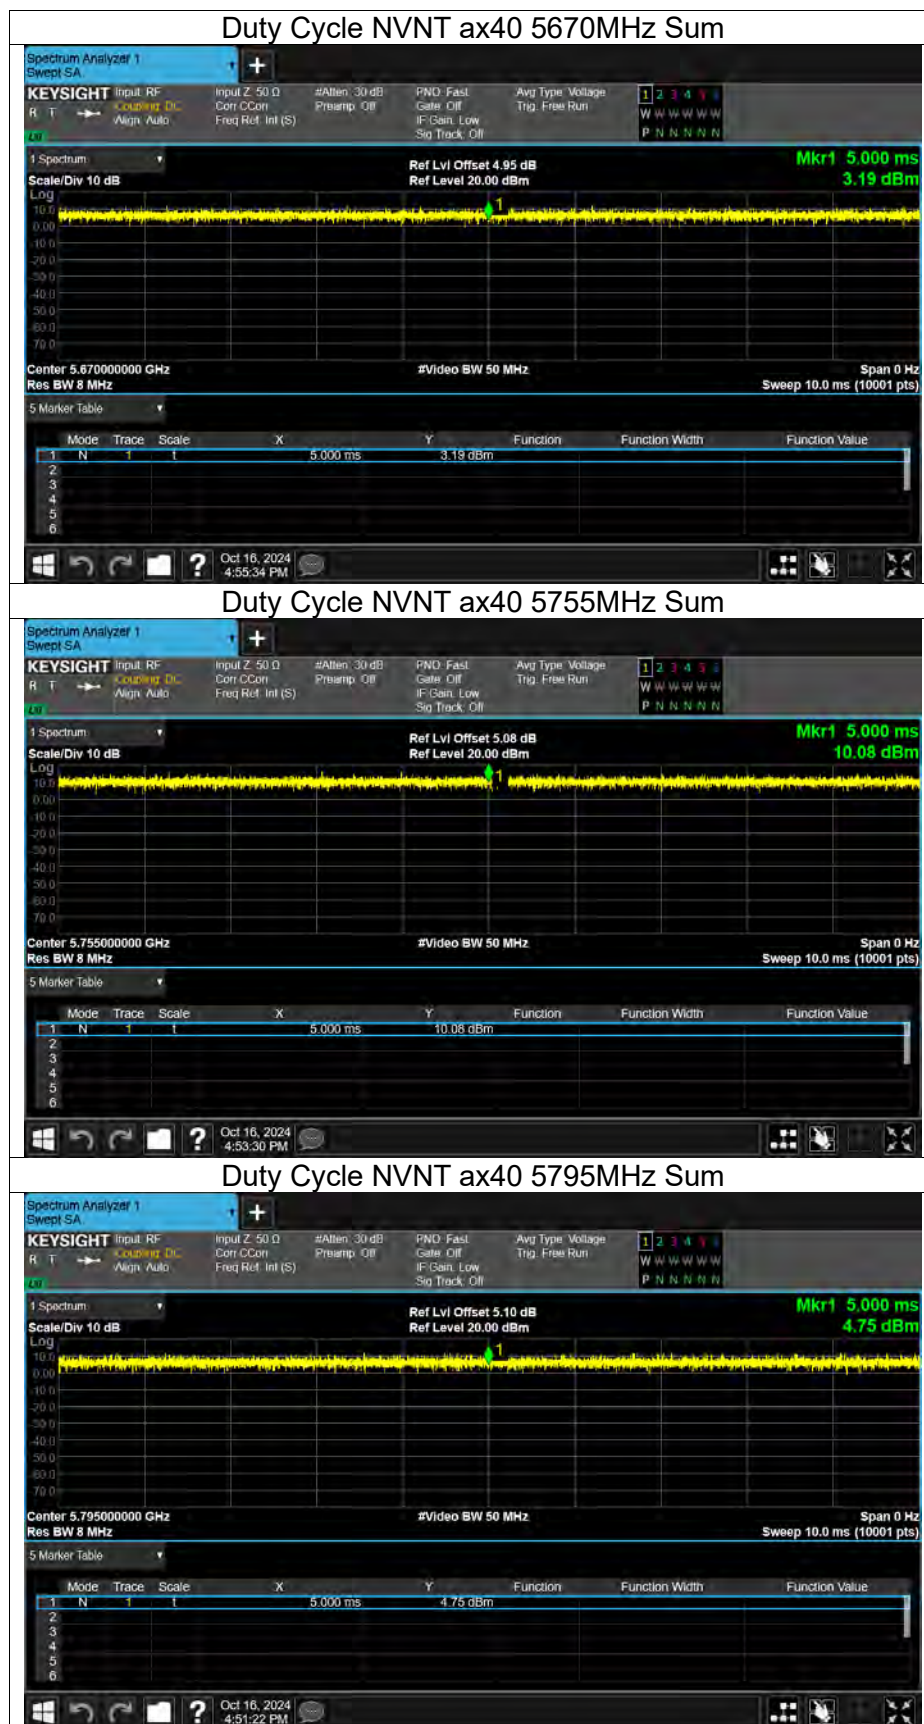


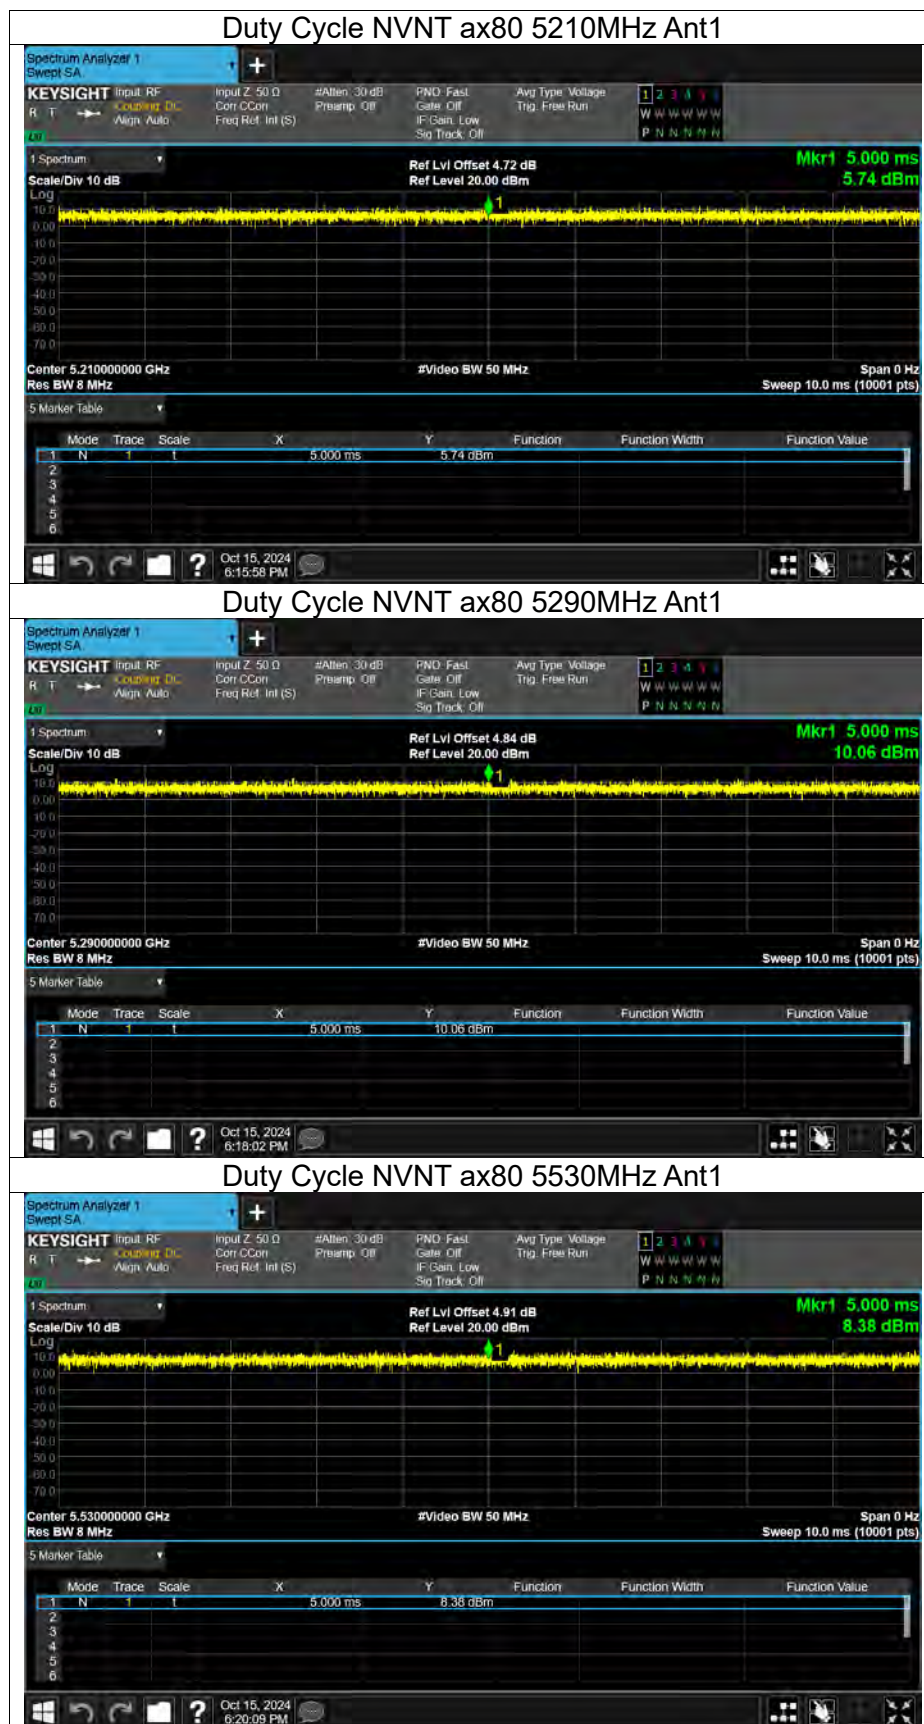

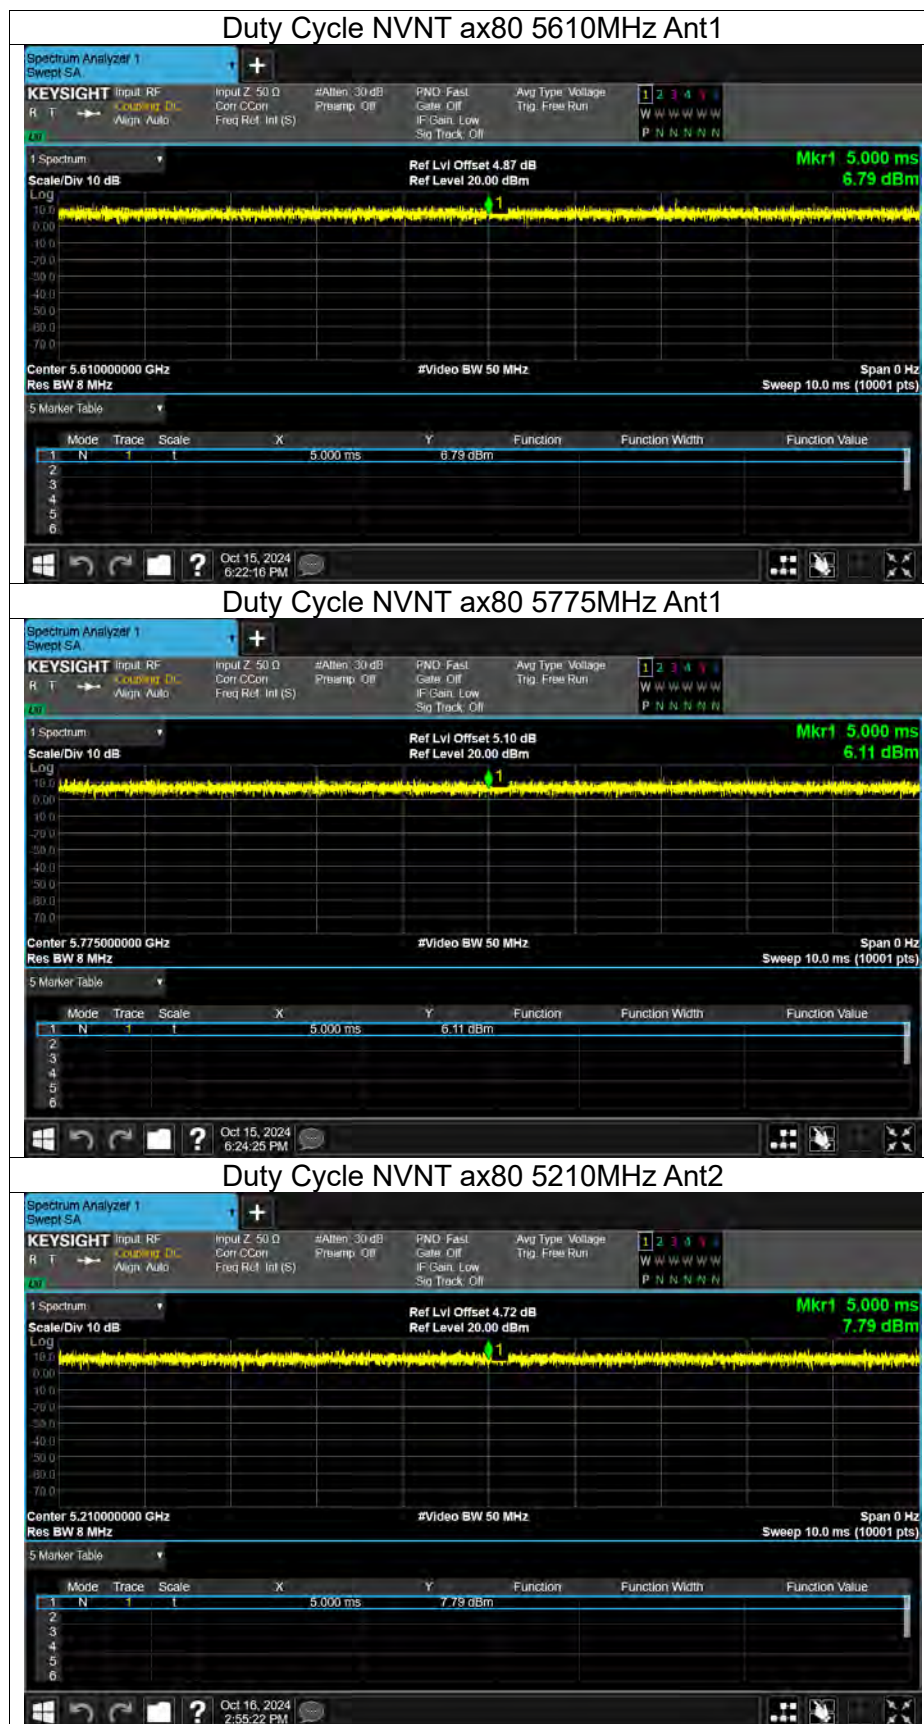

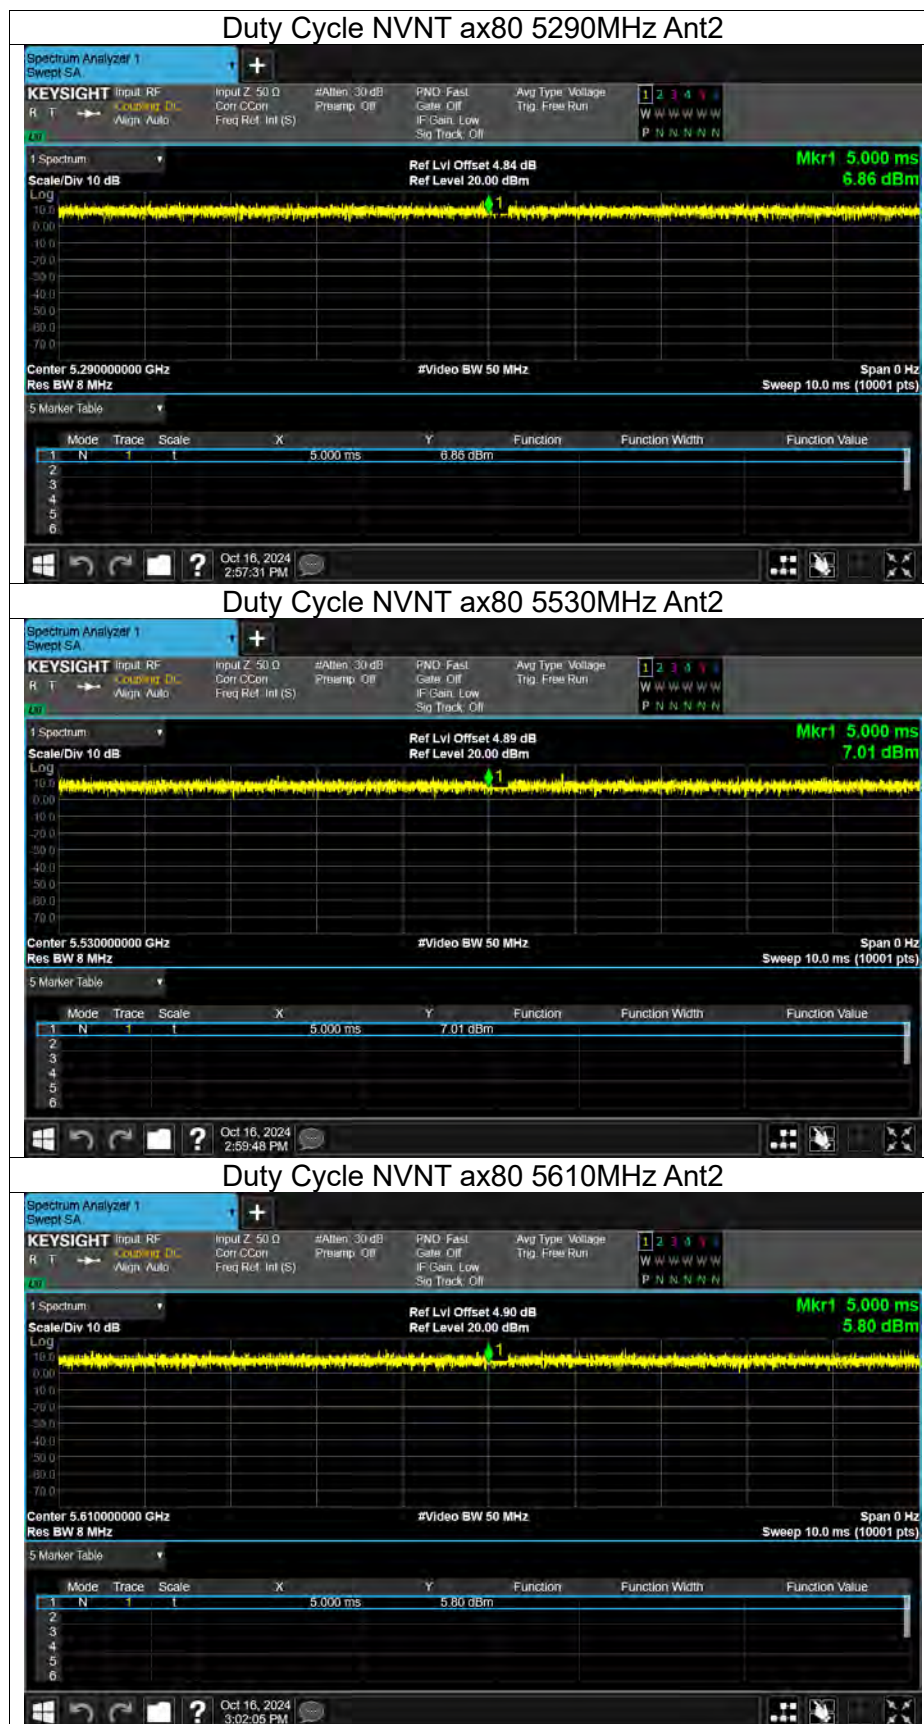

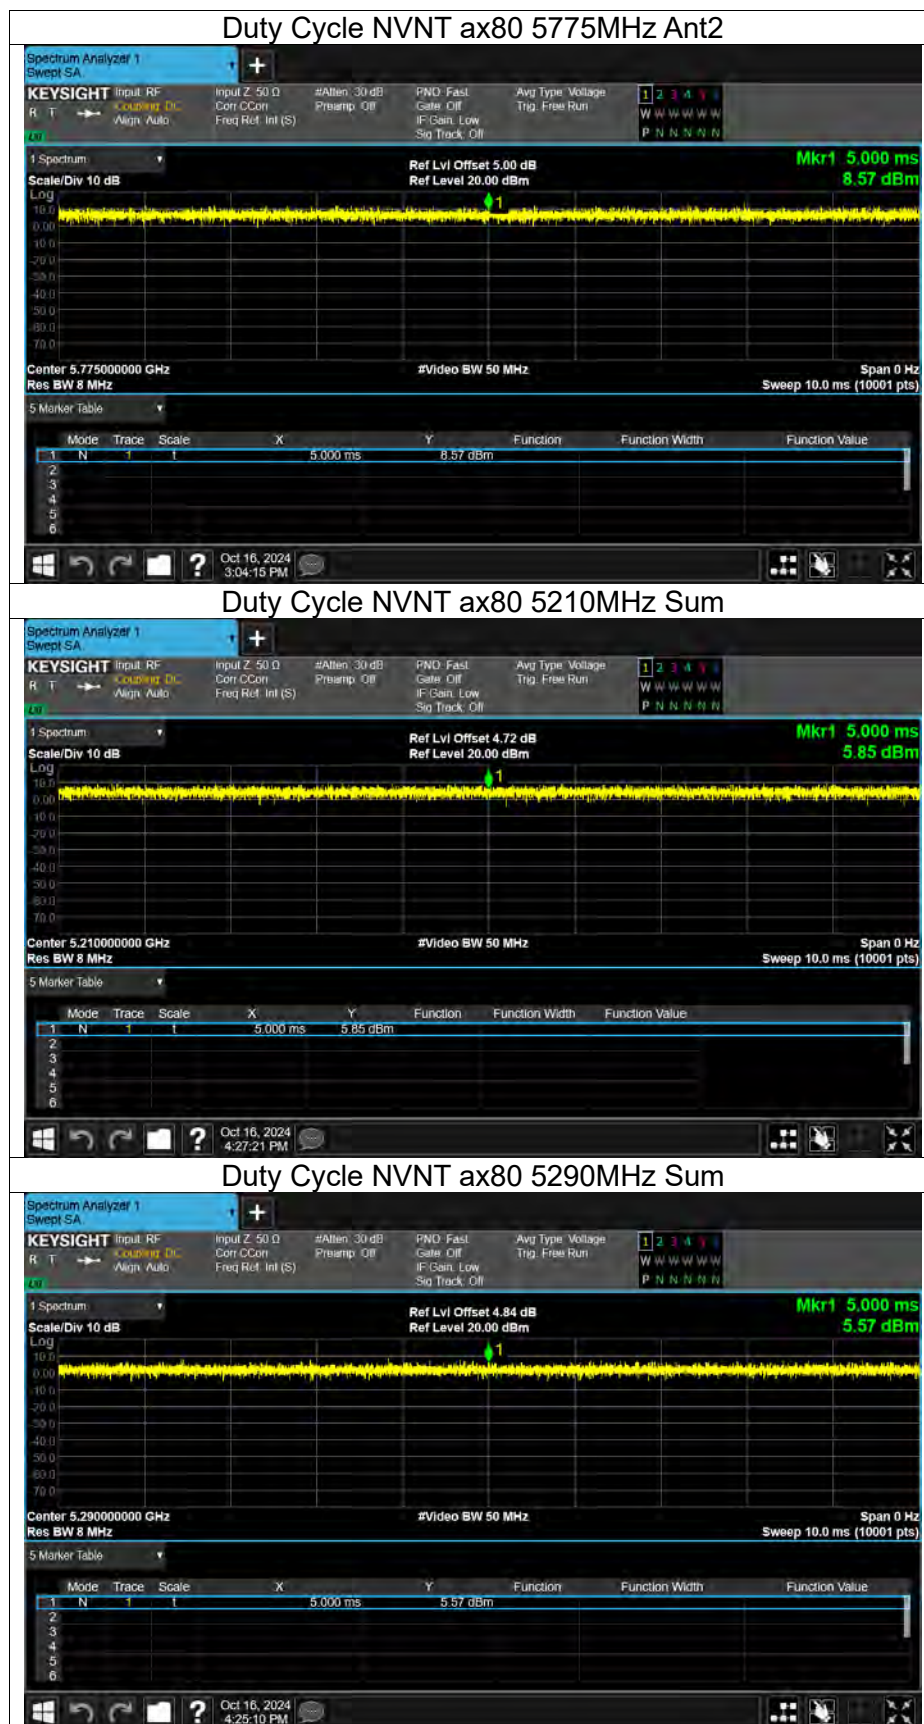

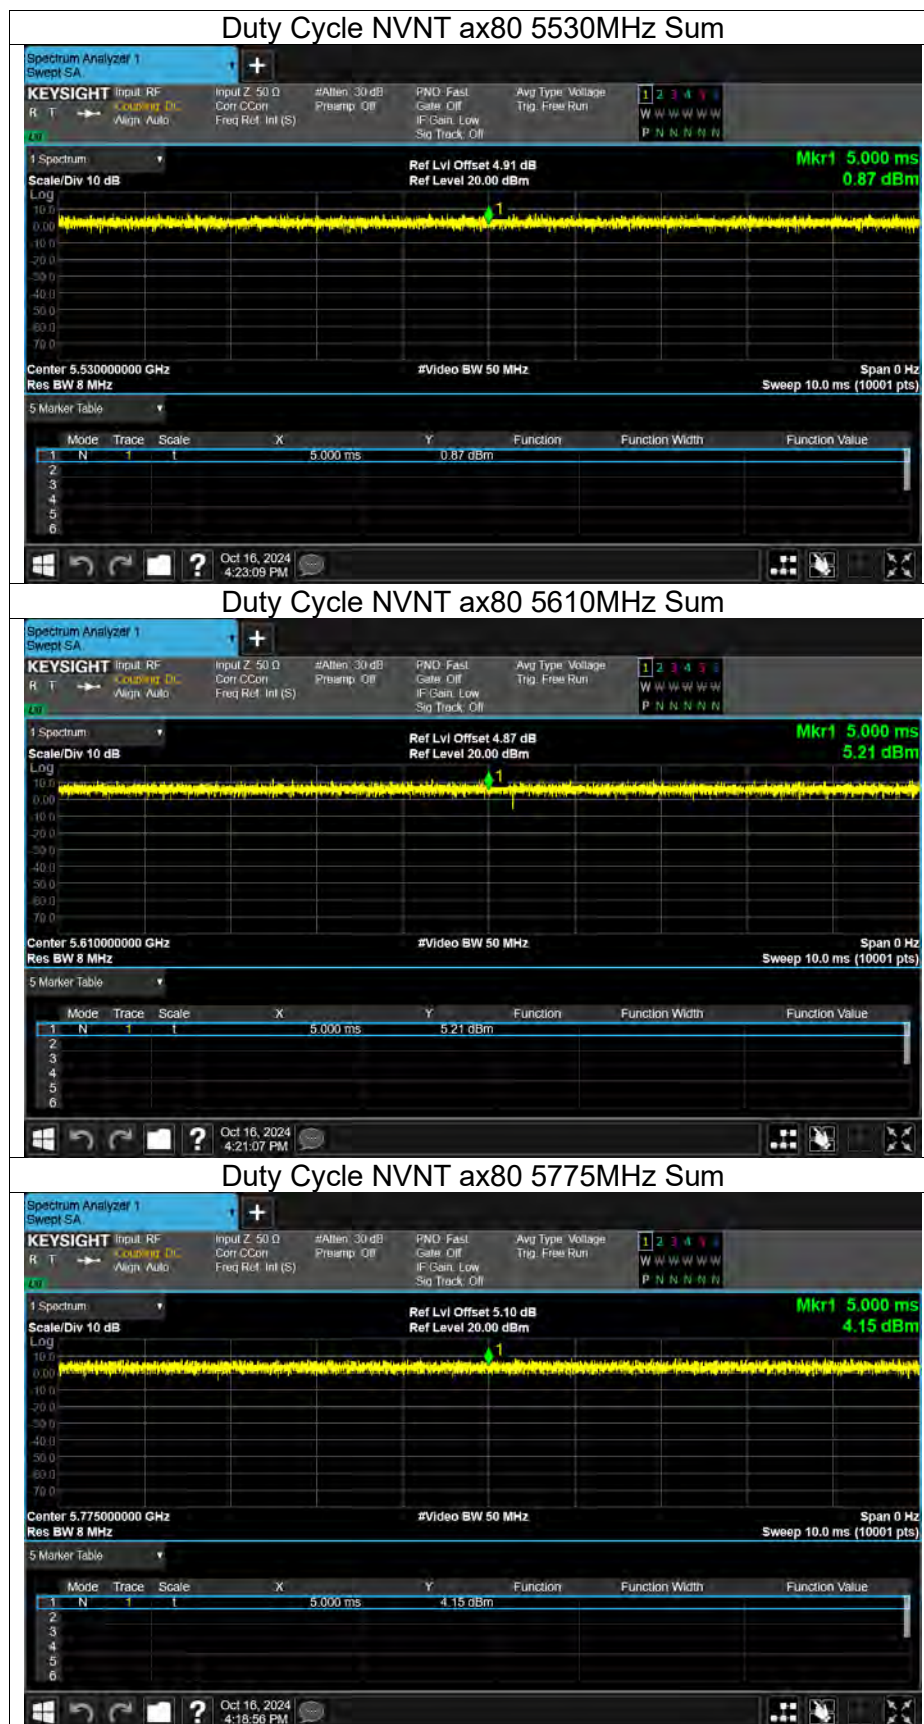



Maximum Conducted Output Power

Condition	Mode	Frequency (MHz)	Antenna	Conducted Power (dBm)	Duty Factor (dB)	Total Power (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	13.2	0	13.2	24	Pass
NVNT	a	5200	Ant1	12.84	0	12.84	24	Pass
NVNT	a	5240	Ant1	13	0	13	24	Pass
NVNT	a	5260	Ant1	13.46	0	13.46	24	Pass
NVNT	a	5300	Ant1	13.09	0	13.09	24	Pass
NVNT	a	5320	Ant1	13.33	0	13.33	24	Pass
NVNT	a	5500	Ant1	14.55	0	14.55	24	Pass
NVNT	a	5580	Ant1	14.64	0	14.64	24	Pass
NVNT	a	5700	Ant1	15.21	0	15.21	24	Pass
NVNT	a	5745	Ant1	15.55	0	15.55	30	Pass
NVNT	a	5785	Ant1	15.43	0	15.43	30	Pass
NVNT	a	5825	Ant1	14.2	0	14.2	30	Pass
NVNT	a	5180	Ant2	15.44	0	15.44	24	Pass
NVNT	a	5200	Ant2	15.51	0	15.51	24	Pass
NVNT	a	5240	Ant2	15.62	0	15.62	24	Pass
NVNT	a	5260	Ant2	15.54	0	15.54	24	Pass
NVNT	a	5300	Ant2	15.02	0	15.02	24	Pass
NVNT	a	5320	Ant2	15.59	0	15.59	24	Pass
NVNT	a	5500	Ant2	14.75	0	14.75	24	Pass
NVNT	a	5580	Ant2	14.57	0	14.57	24	Pass
NVNT	a	5700	Ant2	14.37	0	14.37	24	Pass
NVNT	a	5745	Ant2	14.13	0	14.13	30	Pass
NVNT	a	5785	Ant2	14.13	0	14.13	30	Pass
NVNT	a	5825	Ant2	14.43	0	14.43	30	Pass
NVNT	n20	5180	Ant1	11.48	0	11.48	24	Pass
NVNT	n20	5200	Ant1	11.18	0	11.18	24	Pass
NVNT	n20	5240	Ant1	11.91	0	11.91	24	Pass
NVNT	n20	5260	Ant1	12.2	0	12.2	24	Pass
NVNT	n20	5300	Ant1	11.73	0	11.73	24	Pass
NVNT	n20	5320	Ant1	11.78	0	11.78	24	Pass
NVNT	n20	5500	Ant1	12.08	0	12.08	24	Pass
NVNT	n20	5580	Ant1	14.35	0	14.35	24	Pass
NVNT	n20	5700	Ant1	14.45	0	14.45	24	Pass
NVNT	n20	5745	Ant1	14.24	0	14.24	30	Pass
NVNT	n20	5785	Ant1	12.38	0	12.38	30	Pass
NVNT	n20	5825	Ant1	11.89	0	11.89	30	Pass
NVNT	n20	5180	Ant2	13.83	0	13.83	24	Pass
NVNT	n20	5200	Ant2	13.91	0	13.91	24	Pass
NVNT	n20	5240	Ant2	13.97	0	13.97	24	Pass
NVNT	n20	5260	Ant2	14.24	0	14.24	24	Pass
NVNT	n20	5300	Ant2	13.64	0	13.64	24	Pass
NVNT	n20	5320	Ant2	13.66	0	13.66	24	Pass
NVNT	n20	5500	Ant2	12.23	0	12.23	24	Pass
NVNT	n20	5580	Ant2	12.26	0	12.26	24	Pass
NVNT	n20	5700	Ant2	12.28	0	12.28	24	Pass
NVNT	n20	5745	Ant2	12.19	0	12.19	30	Pass
NVNT	n20	5785	Ant2	12.03	0	12.03	30	Pass
NVNT	n20	5825	Ant2	12.03	0	12.03	30	Pass
NVNT	n20	5180	Ant1	5.73	0	5.73	24	Pass
NVNT	n20	5180	Ant2	10.65	0	10.65	24	Pass
NVNT	n20	5180	Sum	11.86	0	11.86	24	Pass



NVNT	n20	5200	Ant1	8.28	0	8.28	24	Pass
NVNT	n20	5200	Ant2	10.74	0	10.74	24	Pass
NVNT	n20	5200	Sum	12.69	0	12.69	24	Pass
NVNT	n20	5240	Ant1	9.04	0	9.04	24	Pass
NVNT	n20	5240	Ant2	12.34	0	12.34	24	Pass
NVNT	n20	5240	Sum	14.01	0	14.01	24	Pass
NVNT	n20	5260	Ant1	11.43	0	11.43	24	Pass
NVNT	n20	5260	Ant2	11.29	0	11.29	24	Pass
NVNT	n20	5260	Sum	14.37	0	14.37	24	Pass
NVNT	n20	5300	Ant1	6.3	0	6.3	24	Pass
NVNT	n20	5300	Ant2	10.63	0	10.63	24	Pass
NVNT	n20	5300	Sum	11.99	0	11.99	24	Pass
NVNT	n20	5320	Ant1	9.39	0	9.39	24	Pass
NVNT	n20	5320	Ant2	10.56	0	10.56	24	Pass
NVNT	n20	5320	Sum	13.02	0	13.02	24	Pass
NVNT	n20	5500	Ant1	10.42	0	10.42	24	Pass
NVNT	n20	5500	Ant2	9.27	0	9.27	24	Pass
NVNT	n20	5500	Sum	12.89	0	12.89	24	Pass
NVNT	n20	5580	Ant1	12.35	0	12.35	24	Pass
NVNT	n20	5580	Ant2	9.41	0	9.41	24	Pass
NVNT	n20	5580	Sum	14.13	0	14.13	24	Pass
NVNT	n20	5700	Ant1	12.25	0	12.25	24	Pass
NVNT	n20	5700	Ant2	9.21	0	9.21	24	Pass
NVNT	n20	5700	Sum	14	0	14	24	Pass
NVNT	n20	5745	Ant1	8.5	0	8.5	30	Pass
NVNT	n20	5745	Ant2	9.21	0	9.21	30	Pass
NVNT	n20	5745	Sum	11.88	0	11.88	30	Pass
NVNT	n20	5785	Ant1	9.89	0	9.89	30	Pass
NVNT	n20	5785	Ant2	8.99	0	8.99	30	Pass
NVNT	n20	5785	Sum	12.47	0	12.47	30	Pass
NVNT	n20	5825	Ant1	10.75	0	10.75	30	Pass
NVNT	n20	5825	Ant2	8.9	0	8.9	30	Pass
NVNT	n20	5825	Sum	12.93	0	12.93	30	Pass
NVNT	n40	5190	Ant1	11.36	0	11.36	24	Pass
NVNT	n40	5230	Ant1	11.92	0	11.92	24	Pass
NVNT	n40	5270	Ant1	12.2	0	12.2	24	Pass
NVNT	n40	5310	Ant1	12.02	0	12.02	24	Pass
NVNT	n40	5510	Ant1	12.03	0	12.03	24	Pass
NVNT	n40	5550	Ant1	12.19	0	12.19	24	Pass
NVNT	n40	5670	Ant1	12.44	0	12.44	24	Pass
NVNT	n40	5755	Ant1	12.33	0	12.33	30	Pass
NVNT	n40	5795	Ant1	12.15	0	12.15	30	Pass
NVNT	n40	5190	Ant2	14.07	0	14.07	24	Pass
NVNT	n40	5230	Ant2	13.9	0	13.9	24	Pass
NVNT	n40	5270	Ant2	14.21	0	14.21	24	Pass
NVNT	n40	5310	Ant2	13.35	0	13.35	24	Pass
NVNT	n40	5510	Ant2	12.15	0	12.15	24	Pass
NVNT	n40	5550	Ant2	12.26	0	12.26	24	Pass
NVNT	n40	5670	Ant2	12.01	0	12.01	24	Pass
NVNT	n40	5755	Ant2	11.84	0	11.84	30	Pass
NVNT	n40	5795	Ant2	11.88	0	11.88	30	Pass
NVNT	n40	5190	Ant1	7.53	0	7.53	24	Pass
NVNT	n40	5190	Ant2	10.9	0	10.9	24	Pass
NVNT	n40	5190	Sum	12.54	0	12.54	24	Pass
NVNT	n40	5230	Ant1	10.9	0	10.9	24	Pass
NVNT	n40	5230	Ant2	10.81	0	10.81	24	Pass



NVNT	n40	5230	Sum	13.87	0	13.87	24	Pass
NVNT	n40	5270	Ant1	10.12	0	10.12	24	Pass
NVNT	n40	5270	Ant2	10.93	0	10.93	24	Pass
NVNT	n40	5270	Sum	13.55	0	13.55	24	Pass
NVNT	n40	5310	Ant1	8.33	0	8.33	24	Pass
NVNT	n40	5310	Ant2	10.74	0	10.74	24	Pass
NVNT	n40	5310	Sum	12.71	0	12.71	24	Pass
NVNT	n40	5510	Ant1	8.91	0	8.91	24	Pass
NVNT	n40	5510	Ant2	8.95	0	8.95	24	Pass
NVNT	n40	5510	Sum	11.94	0	11.94	24	Pass
NVNT	n40	5550	Ant1	9.08	0	9.08	24	Pass
NVNT	n40	5550	Ant2	9.17	0	9.17	24	Pass
NVNT	n40	5550	Sum	12.14	0	12.14	24	Pass
NVNT	n40	5670	Ant1	10	0	10	24	Pass
NVNT	n40	5670	Ant2	9.06	0	9.06	24	Pass
NVNT	n40	5670	Sum	12.57	0	12.57	24	Pass
NVNT	n40	5755	Ant1	7.63	0	7.63	30	Pass
NVNT	n40	5755	Ant2	8.88	0	8.88	30	Pass
NVNT	n40	5755	Sum	11.31	0	11.31	30	Pass
NVNT	n40	5795	Ant1	11.36	0	11.36	30	Pass
NVNT	n40	5795	Ant2	8.69	0	8.69	30	Pass
NVNT	n40	5795	Sum	13.24	0	13.24	30	Pass
NVNT	ac20	5180	Ant1	10.54	0	10.54	24	Pass
NVNT	ac20	5200	Ant1	10.98	0	10.98	24	Pass
NVNT	ac20	5240	Ant1	11.72	0	11.72	24	Pass
NVNT	ac20	5260	Ant1	12.17	0	12.17	24	Pass
NVNT	ac20	5300	Ant1	11.6	0	11.6	24	Pass
NVNT	ac20	5320	Ant1	11.77	0	11.77	24	Pass
NVNT	ac20	5500	Ant1	12.16	0	12.16	24	Pass
NVNT	ac20	5580	Ant1	12.36	0	12.36	24	Pass
NVNT	ac20	5700	Ant1	12.52	0	12.52	24	Pass
NVNT	ac20	5745	Ant1	12.28	0	12.28	30	Pass
NVNT	ac20	5785	Ant1	12.27	0	12.27	30	Pass
NVNT	ac20	5825	Ant1	11.9	0	11.9	30	Pass
NVNT	ac20	5180	Ant2	13.16	0	13.16	24	Pass
NVNT	ac20	5200	Ant2	13.43	0	13.43	24	Pass
NVNT	ac20	5240	Ant2	13.6	0	13.6	24	Pass
NVNT	ac20	5260	Ant2	13.95	0	13.95	24	Pass
NVNT	ac20	5300	Ant2	13.32	0	13.32	24	Pass
NVNT	ac20	5320	Ant2	13.43	0	13.43	24	Pass
NVNT	ac20	5500	Ant2	12.31	0	12.31	24	Pass
NVNT	ac20	5580	Ant2	12.48	0	12.48	24	Pass
NVNT	ac20	5700	Ant2	12.02	0	12.02	24	Pass
NVNT	ac20	5745	Ant2	11.87	0	11.87	30	Pass
NVNT	ac20	5785	Ant2	11.92	0	11.92	30	Pass
NVNT	ac20	5825	Ant2	11.71	0	11.71	30	Pass
NVNT	ac20	5180	Ant1	5.31	0	5.31	24	Pass
NVNT	ac20	5180	Ant2	10.43	0	10.43	24	Pass
NVNT	ac20	5180	Sum	11.59	0	11.59	24	Pass
NVNT	ac20	5200	Ant1	4.99	0	4.99	24	Pass
NVNT	ac20	5200	Ant2	10.35	0	10.35	24	Pass
NVNT	ac20	5200	Sum	11.46	0	11.46	24	Pass
NVNT	ac20	5240	Ant1	9.17	0	9.17	24	Pass
NVNT	ac20	5240	Ant2	10.53	0	10.53	24	Pass
NVNT	ac20	5240	Sum	12.91	0	12.91	24	Pass
NVNT	ac20	5260	Ant1	9.86	0	9.86	24	Pass



NVNT	ac20	5260	Ant2	10.95	0	10.95	24	Pass
NVNT	ac20	5260	Sum	13.45	0	13.45	24	Pass
NVNT	ac20	5300	Ant1	6.57	0	6.57	24	Pass
NVNT	ac20	5300	Ant2	10.35	0	10.35	24	Pass
NVNT	ac20	5300	Sum	11.87	0	11.87	24	Pass
NVNT	ac20	5320	Ant1	5.48	0	5.48	24	Pass
NVNT	ac20	5320	Ant2	10.24	0	10.24	24	Pass
NVNT	ac20	5320	Sum	11.49	0	11.49	24	Pass
NVNT	ac20	5500	Ant1	9.03	0	9.03	24	Pass
NVNT	ac20	5500	Ant2	8.96	0	8.96	24	Pass
NVNT	ac20	5500	Sum	12.01	0	12.01	24	Pass
NVNT	ac20	5580	Ant1	8.34	0	8.34	24	Pass
NVNT	ac20	5580	Ant2	8.96	0	8.96	24	Pass
NVNT	ac20	5580	Sum	11.67	0	11.67	24	Pass
NVNT	ac20	5700	Ant1	9.3	0	9.3	24	Pass
NVNT	ac20	5700	Ant2	8.92	0	8.92	24	Pass
NVNT	ac20	5700	Sum	12.12	0	12.12	24	Pass
NVNT	ac20	5745	Ant1	11.84	0	11.84	30	Pass
NVNT	ac20	5745	Ant2	8.55	0	8.55	30	Pass
NVNT	ac20	5745	Sum	13.51	0	13.51	30	Pass
NVNT	ac20	5785	Ant1	7.73	0	7.73	30	Pass
NVNT	ac20	5785	Ant2	8.71	0	8.71	30	Pass
NVNT	ac20	5785	Sum	11.26	0	11.26	30	Pass
NVNT	ac20	5825	Ant1	10.14	0	10.14	30	Pass
NVNT	ac20	5825	Ant2	8.56	0	8.56	30	Pass
NVNT	ac20	5825	Sum	12.43	0	12.43	30	Pass
NVNT	ac40	5190	Ant1	11.31	0	11.31	24	Pass
NVNT	ac40	5230	Ant1	11.85	0	11.85	24	Pass
NVNT	ac40	5270	Ant1	12.25	0	12.25	24	Pass
NVNT	ac40	5310	Ant1	11.98	0	11.98	24	Pass
NVNT	ac40	5510	Ant1	12.02	0	12.02	24	Pass
NVNT	ac40	5550	Ant1	12.15	0	12.15	24	Pass
NVNT	ac40	5670	Ant1	12.49	0	12.49	24	Pass
NVNT	ac40	5755	Ant1	12.22	0	12.22	30	Pass
NVNT	ac40	5795	Ant1	12.24	0	12.24	30	Pass
NVNT	ac40	5190	Ant2	13.65	0	13.65	24	Pass
NVNT	ac40	5230	Ant2	13.79	0	13.79	24	Pass
NVNT	ac40	5270	Ant2	13.91	0	13.91	24	Pass
NVNT	ac40	5310	Ant2	13.41	0	13.41	24	Pass
NVNT	ac40	5510	Ant2	11.98	0	11.98	24	Pass
NVNT	ac40	5550	Ant2	12.16	0	12.16	24	Pass
NVNT	ac40	5670	Ant2	11.98	0	11.98	24	Pass
NVNT	ac40	5755	Ant2	11.71	0	11.71	30	Pass
NVNT	ac40	5795	Ant2	11.82	0	11.82	30	Pass
NVNT	ac40	5190	Ant1	7.61	0	7.61	24	Pass
NVNT	ac40	5190	Ant2	10.92	0	10.92	24	Pass
NVNT	ac40	5190	Sum	12.58	0	12.58	24	Pass
NVNT	ac40	5230	Ant1	10.95	0	10.95	24	Pass
NVNT	ac40	5230	Ant2	10.74	0	10.74	24	Pass
NVNT	ac40	5230	Sum	13.86	0	13.86	24	Pass
NVNT	ac40	5270	Ant1	10.18	0	10.18	24	Pass
NVNT	ac40	5270	Ant2	11.27	0	11.27	24	Pass
NVNT	ac40	5270	Sum	13.77	0	13.77	24	Pass
NVNT	ac40	5310	Ant1	8.34	0	8.34	24	Pass
NVNT	ac40	5310	Ant2	10.68	0	10.68	24	Pass
NVNT	ac40	5310	Sum	12.68	0	12.68	24	Pass



NVNT	ac40	5510	Ant1	8.87	0	8.87	24	Pass
NVNT	ac40	5510	Ant2	8.85	0	8.85	24	Pass
NVNT	ac40	5510	Sum	11.87	0	11.87	24	Pass
NVNT	ac40	5550	Ant1	9.17	0	9.17	24	Pass
NVNT	ac40	5550	Ant2	9.07	0	9.07	24	Pass
NVNT	ac40	5550	Sum	12.13	0	12.13	24	Pass
NVNT	ac40	5670	Ant1	7.22	0	7.22	24	Pass
NVNT	ac40	5670	Ant2	8.51	0	8.51	24	Pass
NVNT	ac40	5670	Sum	10.92	0	10.92	24	Pass
NVNT	ac40	5755	Ant1	11.12	0	11.12	30	Pass
NVNT	ac40	5755	Ant2	8.57	0	8.57	30	Pass
NVNT	ac40	5755	Sum	13.04	0	13.04	30	Pass
NVNT	ac40	5795	Ant1	7.5	0	7.5	30	Pass
NVNT	ac40	5795	Ant2	8.66	0	8.66	30	Pass
NVNT	ac40	5795	Sum	11.13	0	11.13	30	Pass
NVNT	ac80	5210	Ant1	11.11	0	11.11	24	Pass
NVNT	ac80	5290	Ant1	11.63	0	11.63	24	Pass
NVNT	ac80	5530	Ant1	11.69	0	11.69	24	Pass
NVNT	ac80	5610	Ant1	12.11	0	12.11	24	Pass
NVNT	ac80	5775	Ant1	12.29	0	12.29	30	Pass
NVNT	ac80	5210	Ant2	12.67	0	12.67	24	Pass
NVNT	ac80	5290	Ant2	13.13	0	13.13	24	Pass
NVNT	ac80	5530	Ant2	11.61	0	11.61	24	Pass
NVNT	ac80	5610	Ant2	11.8	0	11.8	24	Pass
NVNT	ac80	5775	Ant2	11.7	0	11.7	30	Pass
NVNT	ac80	5210	Ant1	9.24	0	9.24	24	Pass
NVNT	ac80	5210	Ant2	10.07	0	10.07	24	Pass
NVNT	ac80	5210	Sum	12.69	0	12.69	24	Pass
NVNT	ac80	5290	Ant1	8.72	0	8.72	24	Pass
NVNT	ac80	5290	Ant2	10.35	0	10.35	24	Pass
NVNT	ac80	5290	Sum	12.62	0	12.62	24	Pass
NVNT	ac80	5530	Ant1	8.37	0	8.37	24	Pass
NVNT	ac80	5530	Ant2	8.51	0	8.51	24	Pass
NVNT	ac80	5530	Sum	11.45	0	11.45	24	Pass
NVNT	ac80	5610	Ant1	10.38	0	10.38	24	Pass
NVNT	ac80	5610	Ant2	8.88	0	8.88	24	Pass
NVNT	ac80	5610	Sum	12.7	0	12.7	24	Pass
NVNT	ac80	5775	Ant1	9.74	0	9.74	30	Pass
NVNT	ac80	5775	Ant2	8.74	0	8.74	30	Pass
NVNT	ac80	5775	Sum	12.28	0	12.28	30	Pass
NVNT	ax20	5180	Ant1	10.65	0	10.65	24	Pass
NVNT	ax20	5200	Ant1	11.03	0	11.03	24	Pass
NVNT	ax20	5240	Ant1	11.8	0	11.8	24	Pass
NVNT	ax20	5260	Ant1	12.06	0	12.06	24	Pass
NVNT	ax20	5300	Ant1	11.73	0	11.73	24	Pass
NVNT	ax20	5320	Ant1	11.69	0	11.69	24	Pass
NVNT	ax20	5500	Ant1	12.06	0	12.06	24	Pass
NVNT	ax20	5580	Ant1	12.22	0	12.22	24	Pass
NVNT	ax20	5700	Ant1	12.49	0	12.49	24	Pass
NVNT	ax20	5745	Ant1	12.2	0	12.2	30	Pass
NVNT	ax20	5785	Ant1	12.07	0	12.07	30	Pass
NVNT	ax20	5825	Ant1	11.8	0	11.8	30	Pass
NVNT	ax20	5180	Ant2	13.32	0	13.32	24	Pass
NVNT	ax20	5200	Ant2	13.6	0	13.6	24	Pass
NVNT	ax20	5240	Ant2	13.65	0	13.65	24	Pass
NVNT	ax20	5260	Ant2	14.04	0	14.04	24	Pass



NVNT	ax20	5300	Ant2	13.51	0	13.51	24	Pass
NVNT	ax20	5320	Ant2	13.34	0	13.34	24	Pass
NVNT	ax20	5500	Ant2	12.25	0	12.25	24	Pass
NVNT	ax20	5580	Ant2	12.28	0	12.28	24	Pass
NVNT	ax20	5700	Ant2	11.92	0	11.92	24	Pass
NVNT	ax20	5745	Ant2	12.01	0	12.01	30	Pass
NVNT	ax20	5785	Ant2	11.94	0	11.94	30	Pass
NVNT	ax20	5825	Ant2	11.98	0	11.98	30	Pass
NVNT	ax20	5180	Ant1	5.18	0	5.18	24	Pass
NVNT	ax20	5180	Ant2	10.28	0	10.28	24	Pass
NVNT	ax20	5180	Sum	11.45	0	11.45	24	Pass
NVNT	ax20	5200	Ant1	5.05	0	5.05	24	Pass
NVNT	ax20	5200	Ant2	10.32	0	10.32	24	Pass
NVNT	ax20	5200	Sum	11.45	0	11.45	24	Pass
NVNT	ax20	5240	Ant1	9.16	0	9.16	24	Pass
NVNT	ax20	5240	Ant2	10.43	0	10.43	24	Pass
NVNT	ax20	5240	Sum	12.85	0	12.85	24	Pass
NVNT	ax20	5260	Ant1	9.78	0	9.78	24	Pass
NVNT	ax20	5260	Ant2	10.94	0	10.94	24	Pass
NVNT	ax20	5260	Sum	13.41	0	13.41	24	Pass
NVNT	ax20	5300	Ant1	6.59	0	6.59	24	Pass
NVNT	ax20	5300	Ant2	10.34	0	10.34	24	Pass
NVNT	ax20	5300	Sum	11.87	0	11.87	24	Pass
NVNT	ax20	5320	Ant1	5.46	0	5.46	24	Pass
NVNT	ax20	5320	Ant2	10.18	0	10.18	24	Pass
NVNT	ax20	5320	Sum	11.44	0	11.44	24	Pass
NVNT	ax20	5500	Ant1	9.42	0	9.42	24	Pass
NVNT	ax20	5500	Ant2	9.22	0	9.22	24	Pass
NVNT	ax20	5500	Sum	12.33	0	12.33	24	Pass
NVNT	ax20	5580	Ant1	8.47	0	8.47	24	Pass
NVNT	ax20	5580	Ant2	9.29	0	9.29	24	Pass
NVNT	ax20	5580	Sum	11.91	0	11.91	24	Pass
NVNT	ax20	5700	Ant1	9.4	0	9.4	24	Pass
NVNT	ax20	5700	Ant2	8.87	0	8.87	24	Pass
NVNT	ax20	5700	Sum	12.15	0	12.15	24	Pass
NVNT	ax20	5745	Ant1	11.98	0	11.98	30	Pass
NVNT	ax20	5745	Ant2	8.68	0	8.68	30	Pass
NVNT	ax20	5745	Sum	13.65	0	13.65	30	Pass
NVNT	ax20	5785	Ant1	7.66	0	7.66	30	Pass
NVNT	ax20	5785	Ant2	9.05	0	9.05	30	Pass
NVNT	ax20	5785	Sum	11.42	0	11.42	30	Pass
NVNT	ax20	5825	Ant1	9.97	0	9.97	30	Pass
NVNT	ax20	5825	Ant2	8.77	0	8.77	30	Pass
NVNT	ax20	5825	Sum	12.42	0	12.42	30	Pass
NVNT	ax40	5190	Ant1	11.51	0	11.51	24	Pass
NVNT	ax40	5230	Ant1	12.19	0	12.19	24	Pass
NVNT	ax40	5270	Ant1	12.29	0	12.29	24	Pass
NVNT	ax40	5310	Ant1	12.15	0	12.15	24	Pass
NVNT	ax40	5510	Ant1	12.23	0	12.23	24	Pass
NVNT	ax40	5550	Ant1	12.27	0	12.27	24	Pass
NVNT	ax40	5670	Ant1	12.6	0	12.6	24	Pass
NVNT	ax40	5755	Ant1	12.7	0	12.7	30	Pass
NVNT	ax40	5795	Ant1	12.48	0	12.48	30	Pass
NVNT	ax40	5190	Ant2	13.79	0	13.79	24	Pass
NVNT	ax40	5230	Ant2	13.77	0	13.77	24	Pass
NVNT	ax40	5270	Ant2	13.9	0	13.9	24	Pass



NVNT	ax40	5310	Ant2	13.79	0	13.79	24	Pass
NVNT	ax40	5510	Ant2	12.13	0	12.13	24	Pass
NVNT	ax40	5550	Ant2	12.15	0	12.15	24	Pass
NVNT	ax40	5670	Ant2	12.22	0	12.22	24	Pass
NVNT	ax40	5755	Ant2	11.93	0	11.93	30	Pass
NVNT	ax40	5795	Ant2	11.82	0	11.82	30	Pass
NVNT	ax40	5190	Ant1	5.44	0	5.44	24	Pass
NVNT	ax40	5190	Ant2	10.67	0	10.67	24	Pass
NVNT	ax40	5190	Sum	11.81	0	11.81	24	Pass
NVNT	ax40	5230	Ant1	8.04	0	8.04	24	Pass
NVNT	ax40	5230	Ant2	10.53	0	10.53	24	Pass
NVNT	ax40	5230	Sum	12.47	0	12.47	24	Pass
NVNT	ax40	5270	Ant1	9.53	0	9.53	24	Pass
NVNT	ax40	5270	Ant2	10.91	0	10.91	24	Pass
NVNT	ax40	5270	Sum	13.28	0	13.28	24	Pass
NVNT	ax40	5310	Ant1	6.41	0	6.41	24	Pass
NVNT	ax40	5310	Ant2	10.61	0	10.61	24	Pass
NVNT	ax40	5310	Sum	12.01	0	12.01	24	Pass
NVNT	ax40	5510	Ant1	9.08	0	9.08	24	Pass
NVNT	ax40	5510	Ant2	8.87	0	8.87	24	Pass
NVNT	ax40	5510	Sum	11.99	0	11.99	24	Pass
NVNT	ax40	5550	Ant1	6.01	0	6.01	24	Pass
NVNT	ax40	5550	Ant2	9.08	0	9.08	24	Pass
NVNT	ax40	5550	Sum	10.82	0	10.82	24	Pass
NVNT	ax40	5670	Ant1	7.72	0	7.72	24	Pass
NVNT	ax40	5670	Ant2	8.78	0	8.78	24	Pass
NVNT	ax40	5670	Sum	11.29	0	11.29	24	Pass
NVNT	ax40	5755	Ant1	11.4	0	11.4	30	Pass
NVNT	ax40	5755	Ant2	8.73	0	8.73	30	Pass
NVNT	ax40	5755	Sum	13.28	0	13.28	30	Pass
NVNT	ax40	5795	Ant1	7.81	0	7.81	30	Pass
NVNT	ax40	5795	Ant2	8.95	0	8.95	30	Pass
NVNT	ax40	5795	Sum	11.43	0	11.43	30	Pass
NVNT	ax80	5210	Ant1	11.47	0	11.47	24	Pass
NVNT	ax80	5290	Ant1	11.8	0	11.8	24	Pass
NVNT	ax80	5530	Ant1	12.3	0	12.3	24	Pass
NVNT	ax80	5610	Ant1	12.25	0	12.25	24	Pass
NVNT	ax80	5775	Ant1	12.43	0	12.43	30	Pass
NVNT	ax80	5210	Ant2	13.15	0	13.15	24	Pass
NVNT	ax80	5290	Ant2	13.51	0	13.51	24	Pass
NVNT	ax80	5530	Ant2	11.9	0	11.9	24	Pass
NVNT	ax80	5610	Ant2	11.89	0	11.89	24	Pass
NVNT	ax80	5775	Ant2	11.81	0	11.81	30	Pass
NVNT	ax80	5210	Ant1	9.34	0	9.34	24	Pass
NVNT	ax80	5210	Ant2	10.37	0	10.37	24	Pass
NVNT	ax80	5210	Sum	12.9	0	12.9	24	Pass
NVNT	ax80	5290	Ant1	9.15	0	9.15	24	Pass
NVNT	ax80	5290	Ant2	10.62	0	10.62	24	Pass
NVNT	ax80	5290	Sum	12.96	0	12.96	24	Pass
NVNT	ax80	5530	Ant1	8.59	0	8.59	24	Pass
NVNT	ax80	5530	Ant2	8.79	0	8.79	24	Pass
NVNT	ax80	5530	Sum	11.7	0	11.7	24	Pass
NVNT	ax80	5610	Ant1	10.72	0	10.72	24	Pass
NVNT	ax80	5610	Ant2	9.27	0	9.27	24	Pass
NVNT	ax80	5610	Sum	13.07	0	13.07	24	Pass
NVNT	ax80	5775	Ant1	9.81	0	9.81	30	Pass



NVNT	ax80	5775	Ant2	8.84	0	8.84	30	Pass
NVNT	ax80	5775	Sum	12.36	0	12.36	30	Pass



-26dB Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	-26 dB Bandwidth (MHz)	Verdict
NVNT	a	5180	Ant1	29.847	Pass
NVNT	a	5200	Ant1	29.301	Pass
NVNT	a	5240	Ant1	22.123	Pass
NVNT	a	5260	Ant1	21.839	Pass
NVNT	a	5300	Ant1	29.272	Pass
NVNT	a	5320	Ant1	29.339	Pass
NVNT	a	5500	Ant1	29.425	Pass
NVNT	a	5580	Ant1	22.83	Pass
NVNT	a	5700	Ant1	27.97	Pass
NVNT	a	5180	Ant2	26.639	Pass
NVNT	a	5200	Ant2	29.696	Pass
NVNT	a	5240	Ant2	22.047	Pass
NVNT	a	5260	Ant2	22.798	Pass
NVNT	a	5300	Ant2	29.588	Pass
NVNT	a	5320	Ant2	28.28	Pass
NVNT	a	5500	Ant2	28.743	Pass
NVNT	a	5580	Ant2	21.957	Pass
NVNT	a	5700	Ant2	23.066	Pass
NVNT	n20	5180	Ant1	29.839	Pass
NVNT	n20	5200	Ant1	29.988	Pass
NVNT	n20	5240	Ant1	23.137	Pass
NVNT	n20	5260	Ant1	22.882	Pass
NVNT	n20	5300	Ant1	29.835	Pass
NVNT	n20	5320	Ant1	28.765	Pass
NVNT	n20	5500	Ant1	29.352	Pass
NVNT	n20	5580	Ant1	23.115	Pass
NVNT	n20	5700	Ant1	27.584	Pass
NVNT	n20	5180	Ant2	28.089	Pass
NVNT	n20	5200	Ant2	29.714	Pass
NVNT	n20	5240	Ant2	23.261	Pass
NVNT	n20	5260	Ant2	23.365	Pass
NVNT	n20	5300	Ant2	29.71	Pass
NVNT	n20	5320	Ant2	29.825	Pass
NVNT	n20	5500	Ant2	29.438	Pass
NVNT	n20	5580	Ant2	23.318	Pass
NVNT	n20	5700	Ant2	27.154	Pass
NVNT	n40	5190	Ant1	47.348	Pass
NVNT	n40	5230	Ant1	39.766	Pass
NVNT	n40	5270	Ant1	40.239	Pass
NVNT	n40	5310	Ant1	52.713	Pass
NVNT	n40	5510	Ant1	50.624	Pass
NVNT	n40	5550	Ant1	39.792	Pass
NVNT	n40	5670	Ant1	59.36	Pass
NVNT	n40	5190	Ant2	43.082	Pass
NVNT	n40	5230	Ant2	39.701	Pass
NVNT	n40	5270	Ant2	39.917	Pass
NVNT	n40	5310	Ant2	42.589	Pass
NVNT	n40	5510	Ant2	46.736	Pass
NVNT	n40	5550	Ant2	39.432	Pass
NVNT	n40	5670	Ant2	49.156	Pass
NVNT	ac20	5180	Ant1	28.831	Pass
NVNT	ac20	5200	Ant1	29.695	Pass
NVNT	ac20	5240	Ant1	23.128	Pass



NVNT	ac20	5260	Ant1	22.625	Pass
NVNT	ac20	5300	Ant1	29.68	Pass
NVNT	ac20	5320	Ant1	28.901	Pass
NVNT	ac20	5500	Ant1	29.011	Pass
NVNT	ac20	5580	Ant1	23.031	Pass
NVNT	ac20	5700	Ant1	28.396	Pass
NVNT	ac20	5180	Ant2	29.286	Pass
NVNT	ac20	5200	Ant2	29.688	Pass
NVNT	ac20	5240	Ant2	21.881	Pass
NVNT	ac20	5260	Ant2	22.721	Pass
NVNT	ac20	5300	Ant2	29.104	Pass
NVNT	ac20	5320	Ant2	28.545	Pass
NVNT	ac20	5500	Ant2	30	Pass
NVNT	ac20	5580	Ant2	22.384	Pass
NVNT	ac20	5700	Ant2	26.945	Pass
NVNT	ac40	5190	Ant1	52.159	Pass
NVNT	ac40	5230	Ant1	40.365	Pass
NVNT	ac40	5270	Ant1	40.392	Pass
NVNT	ac40	5310	Ant1	47.541	Pass
NVNT	ac40	5510	Ant1	50.479	Pass
NVNT	ac40	5550	Ant1	39.67	Pass
NVNT	ac40	5670	Ant1	56.957	Pass
NVNT	ac40	5190	Ant2	42.33	Pass
NVNT	ac40	5230	Ant2	39.376	Pass
NVNT	ac40	5270	Ant2	39.322	Pass
NVNT	ac40	5310	Ant2	43.099	Pass
NVNT	ac40	5510	Ant2	44.245	Pass
NVNT	ac40	5550	Ant2	39.161	Pass
NVNT	ac40	5670	Ant2	54.77	Pass
NVNT	ac80	5210	Ant1	104.328	Pass
NVNT	ac80	5290	Ant1	105.407	Pass
NVNT	ac80	5530	Ant1	106.577	Pass
NVNT	ac80	5610	Ant1	79.215	Pass
NVNT	ac80	5210	Ant2	99.125	Pass
NVNT	ac80	5290	Ant2	104.549	Pass
NVNT	ac80	5530	Ant2	102.892	Pass
NVNT	ac80	5610	Ant2	78.767	Pass
NVNT	ax20	5180	Ant1	29.716	Pass
NVNT	ax20	5200	Ant1	29.536	Pass
NVNT	ax20	5240	Ant1	23.042	Pass
NVNT	ax20	5260	Ant1	23.311	Pass
NVNT	ax20	5300	Ant1	29.178	Pass
NVNT	ax20	5320	Ant1	28.657	Pass
NVNT	ax20	5500	Ant1	28.957	Pass
NVNT	ax20	5580	Ant1	22.396	Pass
NVNT	ax20	5700	Ant1	26.737	Pass
NVNT	ax20	5180	Ant2	29.25	Pass
NVNT	ax20	5200	Ant2	26.132	Pass
NVNT	ax20	5240	Ant2	22.522	Pass
NVNT	ax20	5260	Ant2	22.561	Pass
NVNT	ax20	5300	Ant2	28.638	Pass
NVNT	ax20	5320	Ant2	28.158	Pass
NVNT	ax20	5500	Ant2	27.319	Pass
NVNT	ax20	5580	Ant2	22.501	Pass
NVNT	ax20	5700	Ant2	23.107	Pass
NVNT	ax40	5190	Ant1	46.092	Pass



NVNT	ax40	5230	Ant1	39.243	Pass
NVNT	ax40	5270	Ant1	39.278	Pass
NVNT	ax40	5310	Ant1	46.396	Pass
NVNT	ax40	5510	Ant1	45.812	Pass
NVNT	ax40	5550	Ant1	39.201	Pass
NVNT	ax40	5670	Ant1	55.403	Pass
NVNT	ax40	5190	Ant2	44.704	Pass
NVNT	ax40	5230	Ant2	39.254	Pass
NVNT	ax40	5270	Ant2	39.271	Pass
NVNT	ax40	5310	Ant2	46.019	Pass
NVNT	ax40	5510	Ant2	48.088	Pass
NVNT	ax40	5550	Ant2	39.176	Pass
NVNT	ax40	5670	Ant2	50.675	Pass
NVNT	ax80	5210	Ant1	85.738	Pass
NVNT	ax80	5290	Ant1	87.44	Pass
NVNT	ax80	5530	Ant1	92.217	Pass
NVNT	ax80	5610	Ant1	79.433	Pass
NVNT	ax80	5210	Ant2	81.743	Pass
NVNT	ax80	5290	Ant2	80.719	Pass
NVNT	ax80	5530	Ant2	81.266	Pass
NVNT	ax80	5610	Ant2	79.19	Pass



Test Graphs


-26dB Bandwidth NVNT a 5180MHz Ant1



-26dB Bandwidth NVNT a 5200MHz Ant1



-26dB Bandwidth NVNT a 5240MHz Ant1

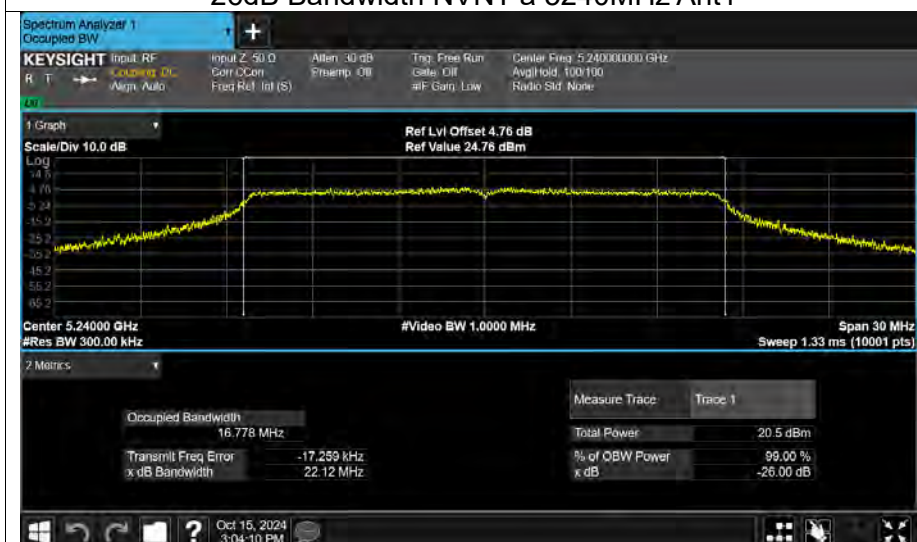



-26dB Bandwidth NVNT a 5260MHz Ant1



-26dB Bandwidth NVNT a 5300MHz Ant1



-26dB Bandwidth NVNT a 5320MHz Ant1





-26dB Bandwidth NVNT a 5500MHz Ant1



-26dB Bandwidth NVNT a 5580MHz Ant1



-26dB Bandwidth NVNT a 5700MHz Ant1





-26dB Bandwidth NVNT a 5180MHz Ant2



-26dB Bandwidth NVNT a 5200MHz Ant2



-26dB Bandwidth NVNT a 5240MHz Ant2





-26dB Bandwidth NVNT a 5260MHz Ant2



-26dB Bandwidth NVNT a 5300MHz Ant2



-26dB Bandwidth NVNT a 5320MHz Ant2






-26dB Bandwidth NVNT a 5500MHz Ant2



-26dB Bandwidth NVNT a 5580MHz Ant2



-26dB Bandwidth NVNT a 5700MHz Ant2

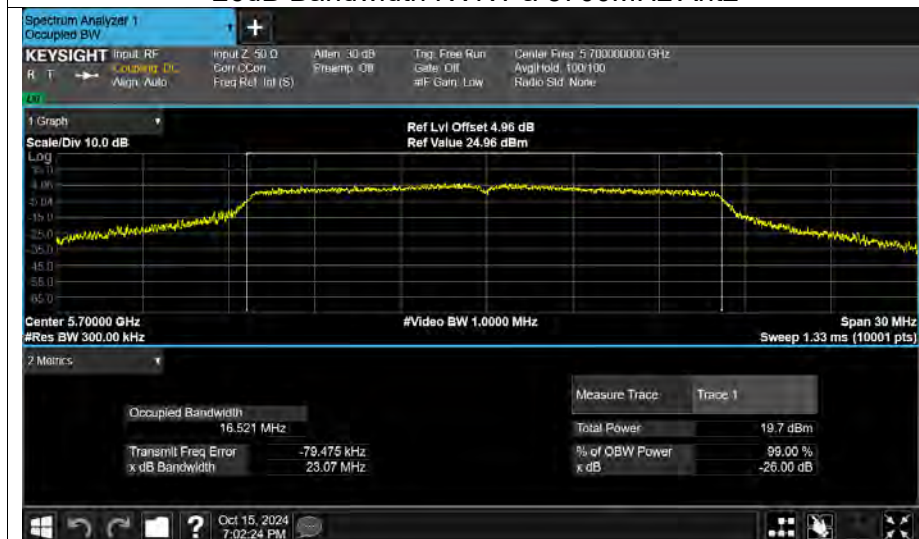



-26dB Bandwidth NVNT n20 5180MHz Ant1



-26dB Bandwidth NVNT n20 5200MHz Ant1



-26dB Bandwidth NVNT n20 5240MHz Ant1





-26dB Bandwidth NVNT n20 5260MHz Ant1






-26dB Bandwidth NVNT n20 5500MHz Ant1



-26dB Bandwidth NVNT n20 5580MHz Ant1



-26dB Bandwidth NVNT n20 5700MHz Ant1

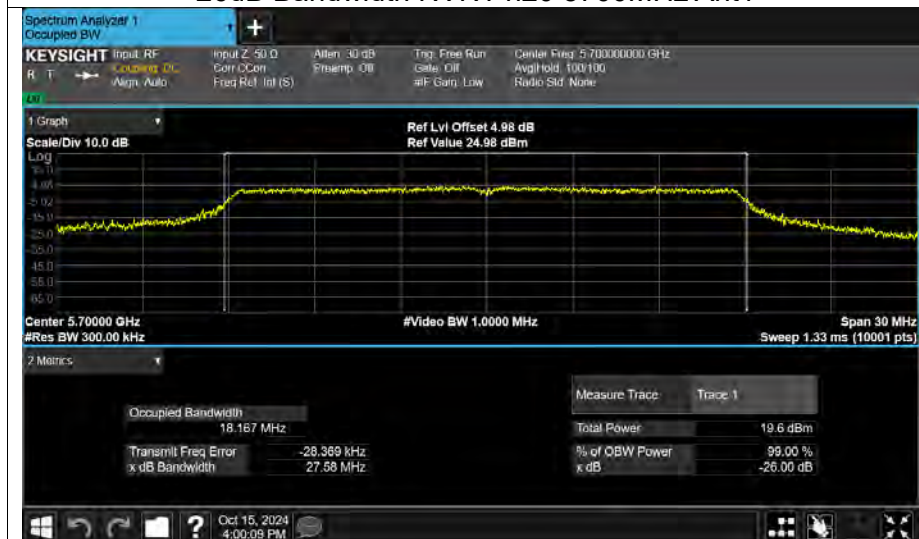



-26dB Bandwidth NVNT n20 5180MHz Ant2



-26dB Bandwidth NVNT n20 5200MHz Ant2



-26dB Bandwidth NVNT n20 5240MHz Ant2







-26dB Bandwidth NVNT n20 5500MHz Ant2



-26dB Bandwidth NVNT n20 5580MHz Ant2



-26dB Bandwidth NVNT n20 5700MHz Ant2





-26dB Bandwidth NVNT n40 5190MHz Ant1



-26dB Bandwidth NVNT n40 5230MHz Ant1



-26dB Bandwidth NVNT n40 5270MHz Ant1








-26dB Bandwidth NVNT n40 5670MHz Ant1



-26dB Bandwidth NVNT n40 5190MHz Ant2



-26dB Bandwidth NVNT n40 5230MHz Ant2

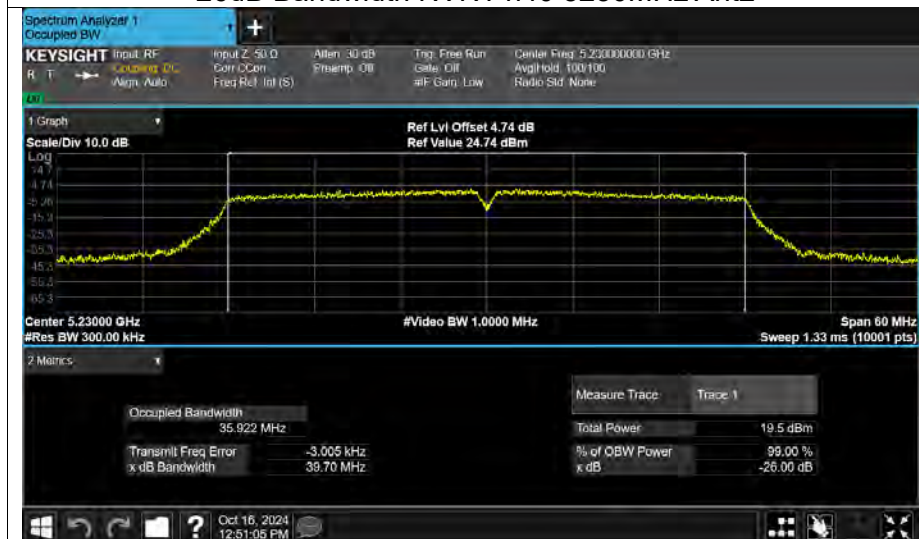



-26dB Bandwidth NVNT n40 5270MHz Ant2



-26dB Bandwidth NVNT n40 5310MHz Ant2



-26dB Bandwidth NVNT n40 5510MHz Ant2





-26dB Bandwidth NVNT n40 5550MHz Ant2



-26dB Bandwidth NVNT n40 5670MHz Ant2



-26dB Bandwidth NVNT ac20 5180MHz Ant1





-26dB Bandwidth NVNT ac20 5200MHz Ant1



-26dB Bandwidth NVNT ac20 5240MHz Ant1



-26dB Bandwidth NVNT ac20 5260MHz Ant1





-26dB Bandwidth NVNT ac20 5300MHz Ant1






-26dB Bandwidth NVNT ac20 5320MHz Ant1



-26dB Bandwidth NVNT ac20 5500MHz Ant1



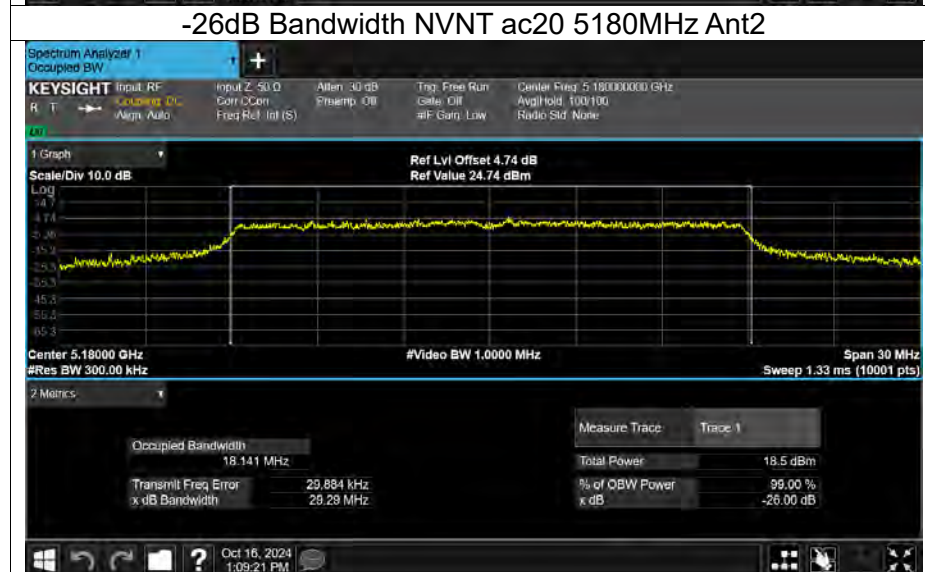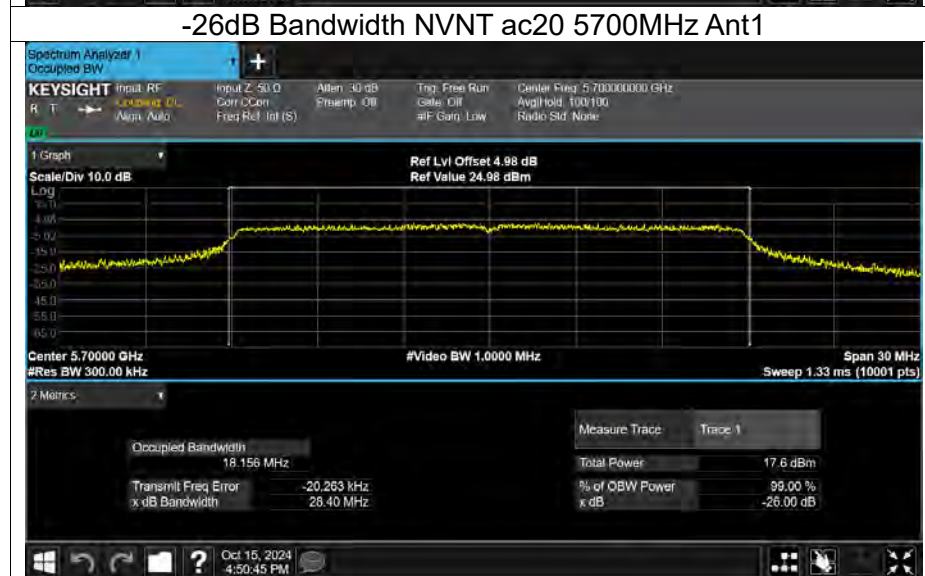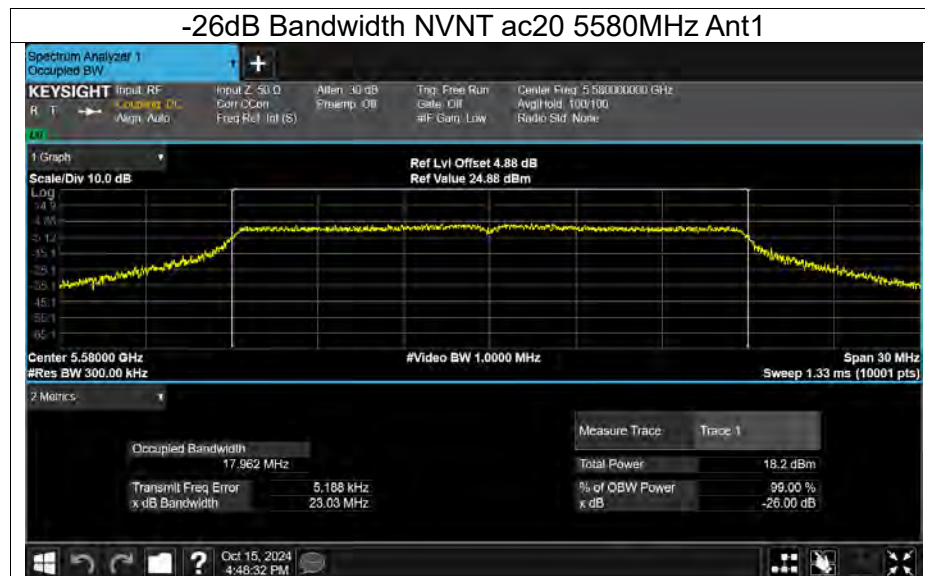



-26dB Bandwidth NVNT ac20 5200MHz Ant2



-26dB Bandwidth NVNT ac20 5240MHz Ant2



-26dB Bandwidth NVNT ac20 5260MHz Ant2





-26dB Bandwidth NVNT ac20 5300MHz Ant2






-26dB Bandwidth NVNT ac20 5320MHz Ant2



-26dB Bandwidth NVNT ac20 5500MHz Ant2



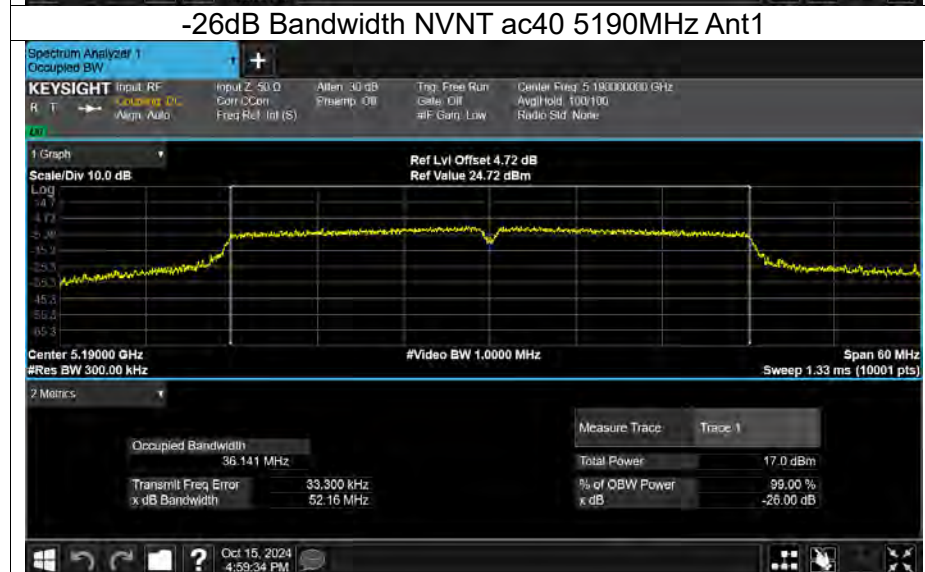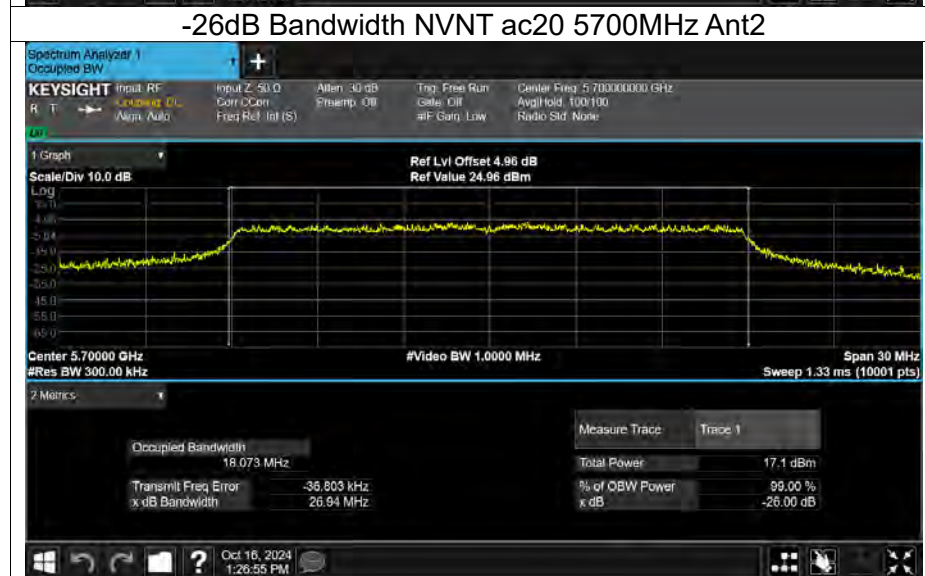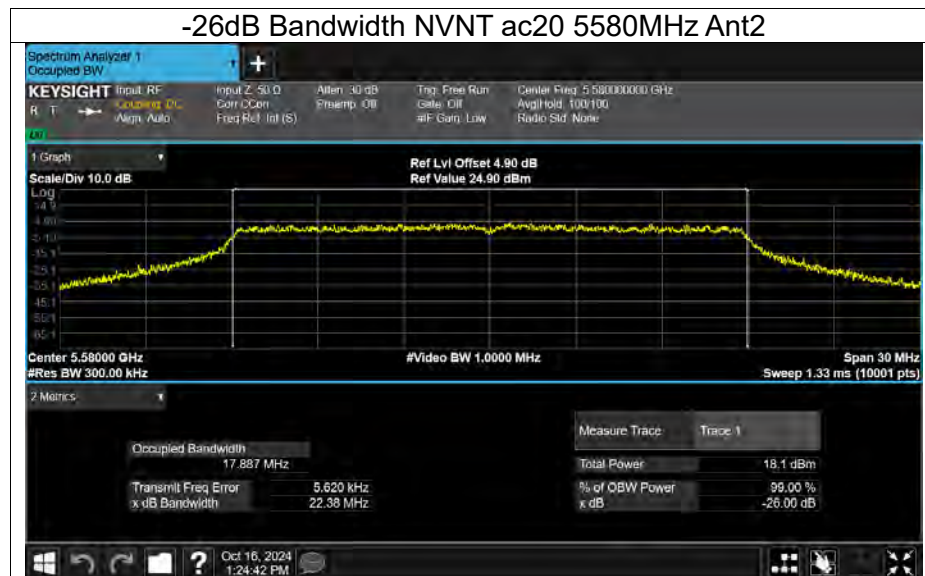



-26dB Bandwidth NVNT ac40 5230MHz Ant1



-26dB Bandwidth NVNT ac40 5270MHz Ant1



-26dB Bandwidth NVNT ac40 5310MHz Ant1





-26dB Bandwidth NVNT ac40 5510MHz Ant1




-26dB Bandwidth NVNT ac40 5550MHz Ant1



-26dB Bandwidth NVNT ac40 5670MHz Ant1



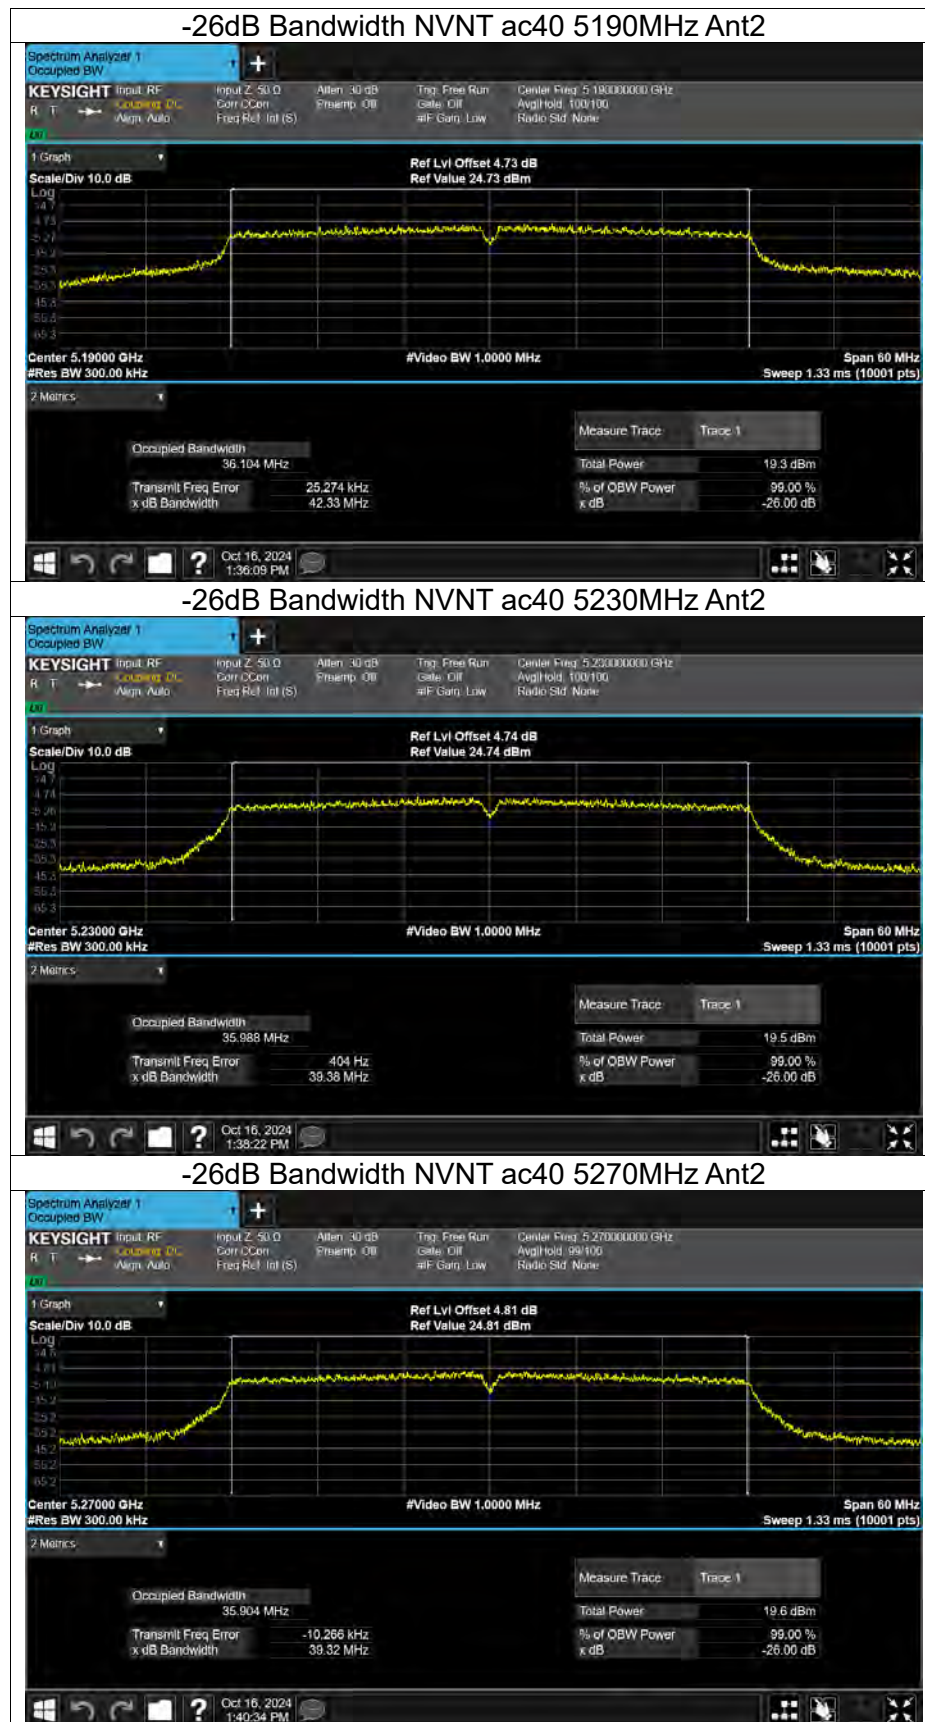




-26dB Bandwidth NVNT ac40 5310MHz Ant2






-26dB Bandwidth NVNT ac40 5510MHz Ant2

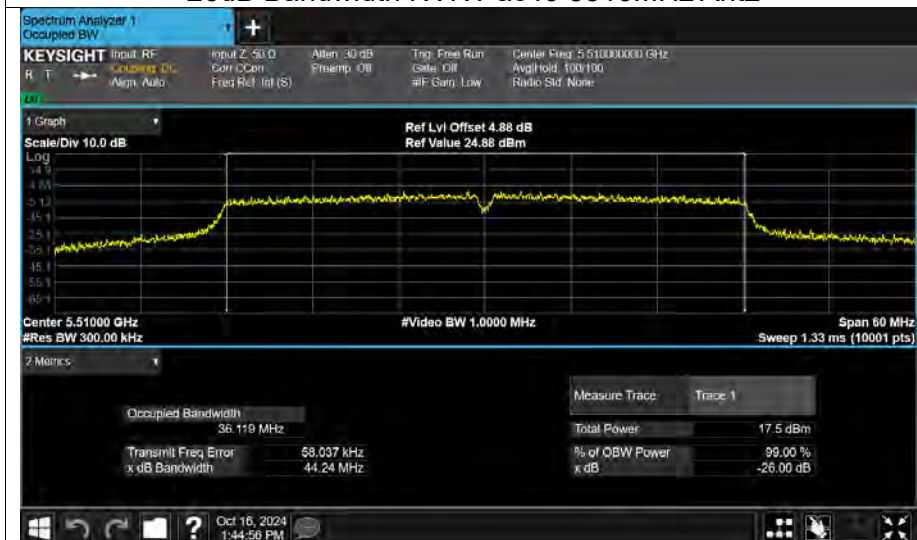

-26dB Bandwidth NVNT ac40 5550MHz Ant2



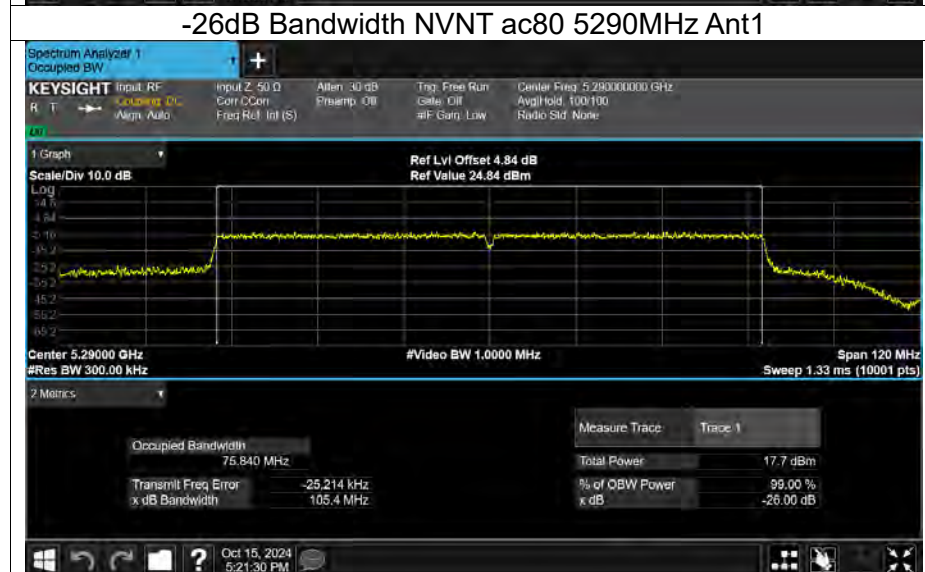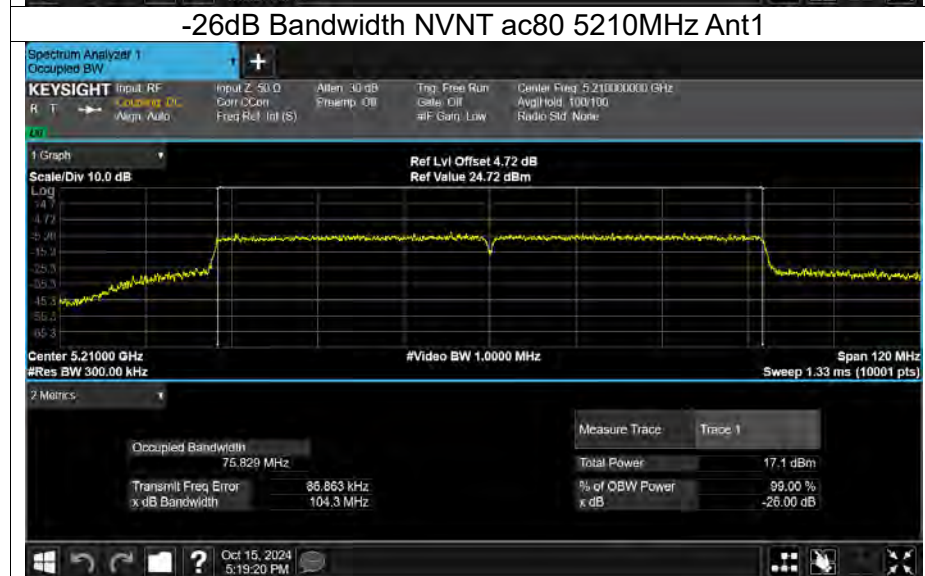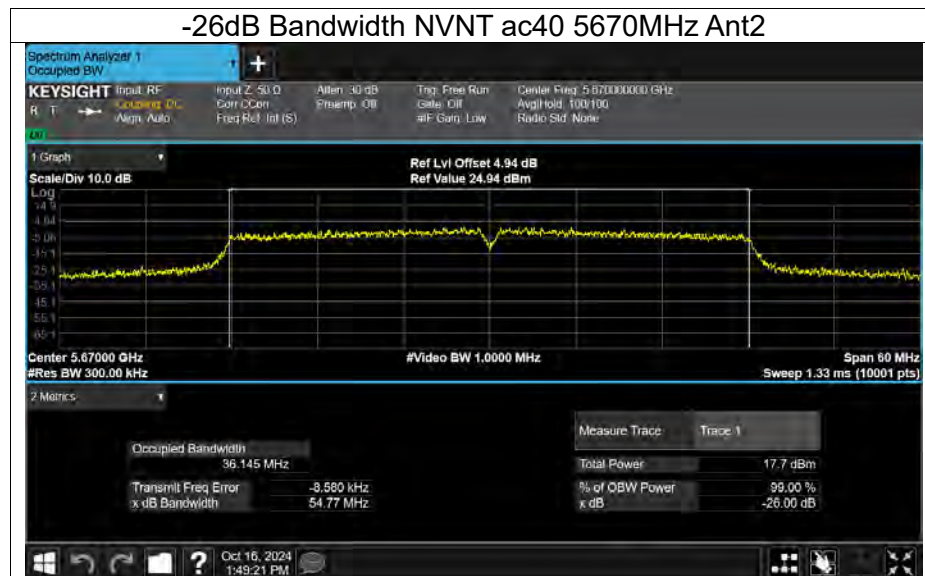



-26dB Bandwidth NVNT ac80 5530MHz Ant1



-26dB Bandwidth NVNT ac80 5610MHz Ant1



-26dB Bandwidth NVNT ac80 5210MHz Ant2





-26dB Bandwidth NVNT ac80 5290MHz Ant2



-26dB Bandwidth NVNT ac80 5530MHz Ant2



-26dB Bandwidth NVNT ac80 5610MHz Ant2




-26dB Bandwidth NVNT ax20 5180MHz Ant1



-26dB Bandwidth NVNT ax20 5200MHz Ant1



-26dB Bandwidth NVNT ax20 5240MHz Ant1

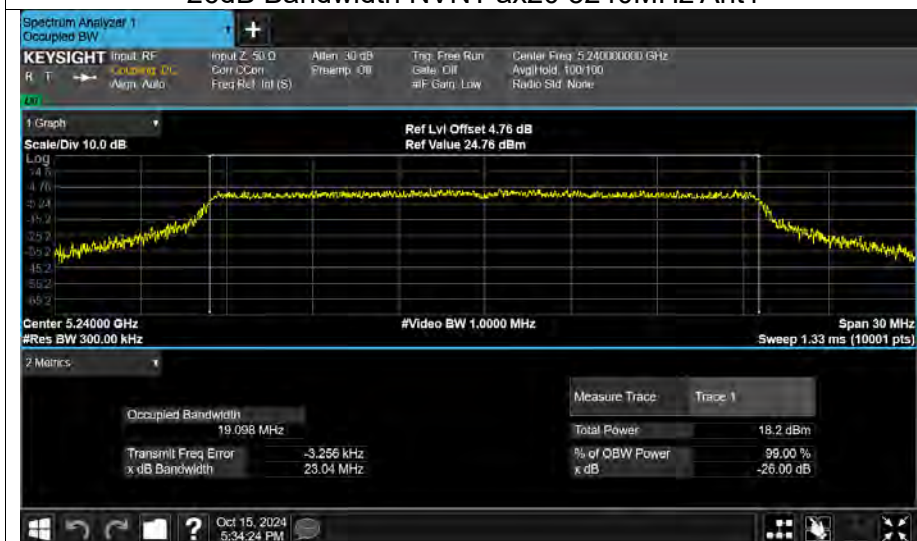





-26dB Bandwidth NVNT ax20 5500MHz Ant1



-26dB Bandwidth NVNT ax20 5580MHz Ant1



-26dB Bandwidth NVNT ax20 5700MHz Ant1





-26dB Bandwidth NVNT ax20 5180MHz Ant2



-26dB Bandwidth NVNT ax20 5200MHz Ant2




-26dB Bandwidth NVNT ax20 5240MHz Ant2





-26dB Bandwidth NVNT ax20 5260MHz Ant2

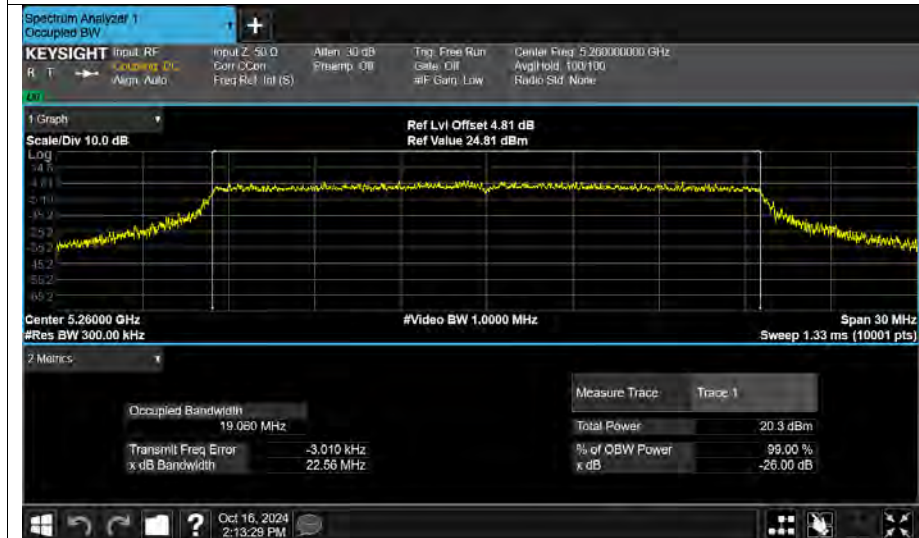

-26dB Bandwidth NVNT ax20 5300MHz Ant2



-26dB Bandwidth NVNT ax20 5320MHz Ant2





-26dB Bandwidth NVNT ax20 5500MHz Ant2



-26dB Bandwidth NVNT ax20 5580MHz Ant2



-26dB Bandwidth NVNT ax20 5700MHz Ant2





-26dB Bandwidth NVNT ax40 5190MHz Ant1



-26dB Bandwidth NVNT ax40 5230MHz Ant1



-26dB Bandwidth NVNT ax40 5270MHz Ant1





-26dB Bandwidth NVNT ax40 5310MHz Ant1



-26dB Bandwidth NVNT ax40 5510MHz Ant1




-26dB Bandwidth NVNT ax40 5550MHz Ant1





-26dB Bandwidth NVNT ax40 5670MHz Ant1

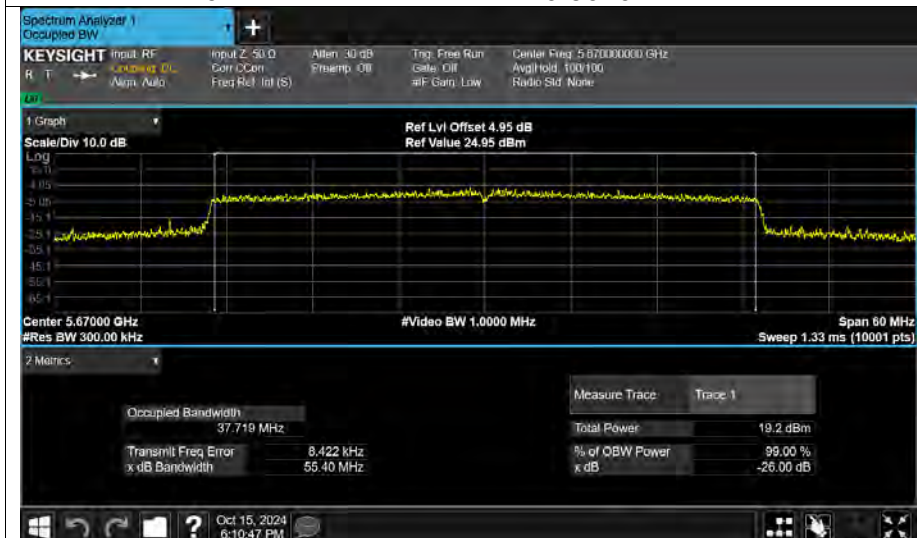

-26dB Bandwidth NVNT ax40 5190MHz Ant2



-26dB Bandwidth NVNT ax40 5230MHz Ant2





-26dB Bandwidth NVNT ax40 5270MHz Ant2



-26dB Bandwidth NVNT ax40 5310MHz Ant2



-26dB Bandwidth NVNT ax40 5510MHz Ant2





-26dB Bandwidth NVNT ax40 5550MHz Ant2



-26dB Bandwidth NVNT ax40 5670MHz Ant2



-26dB Bandwidth NVNT ax80 5210MHz Ant1



-26dB Bandwidth NVNT ax80 5290MHz Ant1



-26dB Bandwidth NVNT ax80 5530MHz Ant1



-26dB Bandwidth NVNT ax80 5610MHz Ant1





-26dB Bandwidth NVNT ax80 5210MHz Ant2




-26dB Bandwidth NVNT ax80 5290MHz Ant2



-26dB Bandwidth NVNT ax80 5530MHz Ant2



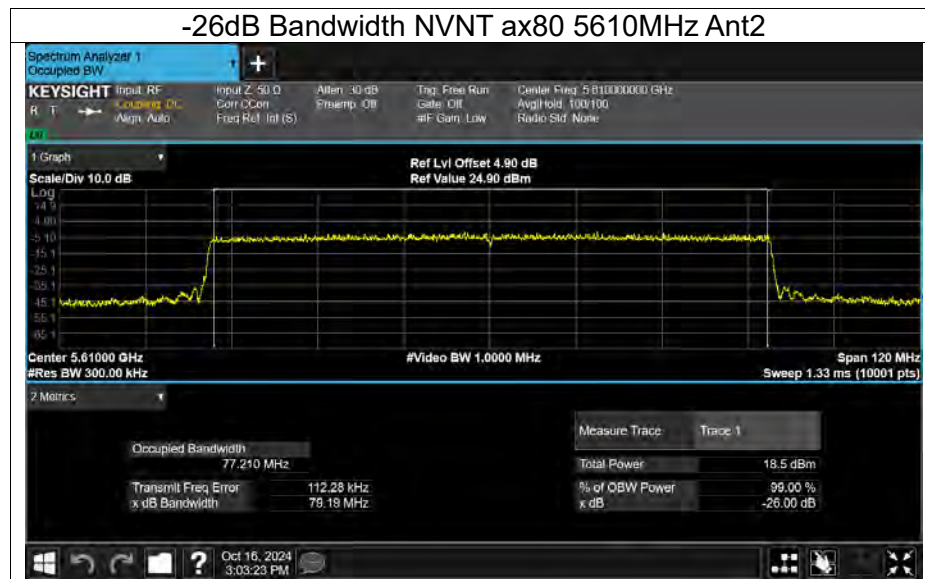



Occupied Channel Bandwidth

Condition	Mode	Frequency (MHz)	Antenna	99% OBW (MHz)
NVNT	a	5180	Ant1	17.595
NVNT	a	5200	Ant1	16.87
NVNT	a	5240	Ant1	16.59
NVNT	a	5260	Ant1	16.589
NVNT	a	5300	Ant1	16.901
NVNT	a	5320	Ant1	16.913
NVNT	a	5500	Ant1	16.853
NVNT	a	5580	Ant1	16.592
NVNT	a	5700	Ant1	16.823
NVNT	a	5745	Ant1	16.743
NVNT	a	5785	Ant1	16.608
NVNT	a	5825	Ant1	16.595
NVNT	a	5180	Ant2	17.214
NVNT	a	5200	Ant2	16.86
NVNT	a	5240	Ant2	16.592
NVNT	a	5260	Ant2	16.626
NVNT	a	5300	Ant2	16.889
NVNT	a	5320	Ant2	16.858
NVNT	a	5500	Ant2	16.836
NVNT	a	5580	Ant2	16.603
NVNT	a	5700	Ant2	16.435
NVNT	a	5745	Ant2	16.759
NVNT	a	5785	Ant2	16.606
NVNT	a	5825	Ant2	16.571
NVNT	n20	5180	Ant1	18.053
NVNT	n20	5200	Ant1	18.031
NVNT	n20	5240	Ant1	17.801
NVNT	n20	5260	Ant1	17.809
NVNT	n20	5300	Ant1	18.027
NVNT	n20	5320	Ant1	18.055
NVNT	n20	5500	Ant1	18.066
NVNT	n20	5580	Ant1	17.82
NVNT	n20	5700	Ant1	17.989
NVNT	n20	5745	Ant1	17.946
NVNT	n20	5785	Ant1	17.812
NVNT	n20	5825	Ant1	17.802
NVNT	n20	5180	Ant2	18.057
NVNT	n20	5200	Ant2	18.009
NVNT	n20	5240	Ant2	17.808
NVNT	n20	5260	Ant2	17.805
NVNT	n20	5300	Ant2	18.217
NVNT	n20	5320	Ant2	18.011
NVNT	n20	5500	Ant2	18.056
NVNT	n20	5580	Ant2	17.807
NVNT	n20	5700	Ant2	17.991
NVNT	n20	5745	Ant2	17.921
NVNT	n20	5785	Ant2	17.806
NVNT	n20	5825	Ant2	17.817
NVNT	n40	5190	Ant1	36.23
NVNT	n40	5230	Ant1	36.071
NVNT	n40	5270	Ant1	36.064
NVNT	n40	5310	Ant1	36.236
NVNT	n40	5510	Ant1	36.239



NVNT	n40	5550	Ant1	36.046
NVNT	n40	5670	Ant1	36.277
NVNT	n40	5755	Ant1	36.218
NVNT	n40	5795	Ant1	36.056
NVNT	n40	5190	Ant2	36.119
NVNT	n40	5230	Ant2	35.972
NVNT	n40	5270	Ant2	36.01
NVNT	n40	5310	Ant2	36.17
NVNT	n40	5510	Ant2	36.151
NVNT	n40	5550	Ant2	35.904
NVNT	n40	5670	Ant2	36.201
NVNT	n40	5755	Ant2	36.131
NVNT	n40	5795	Ant2	36.054
NVNT	ac20	5180	Ant1	18.061
NVNT	ac20	5200	Ant1	18.052
NVNT	ac20	5240	Ant1	17.814
NVNT	ac20	5260	Ant1	17.822
NVNT	ac20	5300	Ant1	18.047
NVNT	ac20	5320	Ant1	18.031
NVNT	ac20	5500	Ant1	18.044
NVNT	ac20	5580	Ant1	17.81
NVNT	ac20	5700	Ant1	18.004
NVNT	ac20	5745	Ant1	17.948
NVNT	ac20	5785	Ant1	17.804
NVNT	ac20	5825	Ant1	17.823
NVNT	ac20	5180	Ant2	18.049
NVNT	ac20	5200	Ant2	18.051
NVNT	ac20	5240	Ant2	17.758
NVNT	ac20	5260	Ant2	17.758
NVNT	ac20	5300	Ant2	18.014
NVNT	ac20	5320	Ant2	18.027
NVNT	ac20	5500	Ant2	17.995
NVNT	ac20	5580	Ant2	17.743
NVNT	ac20	5700	Ant2	17.985
NVNT	ac20	5745	Ant2	17.924
NVNT	ac20	5785	Ant2	17.757
NVNT	ac20	5825	Ant2	17.795
NVNT	ac40	5190	Ant1	36.181
NVNT	ac40	5230	Ant1	36.093
NVNT	ac40	5270	Ant1	36.044
NVNT	ac40	5310	Ant1	36.21
NVNT	ac40	5510	Ant1	36.316
NVNT	ac40	5550	Ant1	36.075
NVNT	ac40	5670	Ant1	36.283
NVNT	ac40	5755	Ant1	36.206
NVNT	ac40	5795	Ant1	36.073
NVNT	ac40	5190	Ant2	36.138
NVNT	ac40	5230	Ant2	35.98
NVNT	ac40	5270	Ant2	36.009
NVNT	ac40	5310	Ant2	36.161
NVNT	ac40	5510	Ant2	36.125
NVNT	ac40	5550	Ant2	35.917
NVNT	ac40	5670	Ant2	36.213
NVNT	ac40	5755	Ant2	36.163
NVNT	ac40	5795	Ant2	36.002
NVNT	ac80	5210	Ant1	75.875



NVNT	ac80	5290	Ant1	75.906
NVNT	ac80	5530	Ant1	75.899
NVNT	ac80	5610	Ant1	75.646
NVNT	ac80	5775	Ant1	75.739
NVNT	ac80	5210	Ant2	75.546
NVNT	ac80	5290	Ant2	75.613
NVNT	ac80	5530	Ant2	75.598
NVNT	ac80	5610	Ant2	75.424
NVNT	ac80	5775	Ant2	75.43
NVNT	ax20	5180	Ant1	19.093
NVNT	ax20	5200	Ant1	19.16
NVNT	ax20	5240	Ant1	19.07
NVNT	ax20	5260	Ant1	19.054
NVNT	ax20	5300	Ant1	19.086
NVNT	ax20	5320	Ant1	19.141
NVNT	ax20	5500	Ant1	19.154
NVNT	ax20	5580	Ant1	19.029
NVNT	ax20	5700	Ant1	19.081
NVNT	ax20	5745	Ant1	19.131
NVNT	ax20	5785	Ant1	19.029
NVNT	ax20	5825	Ant1	19.05
NVNT	ax20	5180	Ant2	19.095
NVNT	ax20	5200	Ant2	19.12
NVNT	ax20	5240	Ant2	19.018
NVNT	ax20	5260	Ant2	19.016
NVNT	ax20	5300	Ant2	19.14
NVNT	ax20	5320	Ant2	19.141
NVNT	ax20	5500	Ant2	19.086
NVNT	ax20	5580	Ant2	19.055
NVNT	ax20	5700	Ant2	18.893
NVNT	ax20	5745	Ant2	19.077
NVNT	ax20	5785	Ant2	18.999
NVNT	ax20	5825	Ant2	19
NVNT	ax40	5190	Ant1	37.712
NVNT	ax40	5230	Ant1	37.572
NVNT	ax40	5270	Ant1	37.558
NVNT	ax40	5310	Ant1	37.762
NVNT	ax40	5510	Ant1	37.682
NVNT	ax40	5550	Ant1	37.545
NVNT	ax40	5670	Ant1	37.69
NVNT	ax40	5755	Ant1	37.687
NVNT	ax40	5795	Ant1	37.562
NVNT	ax40	5190	Ant2	37.617
NVNT	ax40	5230	Ant2	37.487
NVNT	ax40	5270	Ant2	37.535
NVNT	ax40	5310	Ant2	37.672
NVNT	ax40	5510	Ant2	37.573
NVNT	ax40	5550	Ant2	37.548
NVNT	ax40	5670	Ant2	37.68
NVNT	ax40	5755	Ant2	37.645
NVNT	ax40	5795	Ant2	37.51
NVNT	ax80	5210	Ant1	77.366
NVNT	ax80	5290	Ant1	77.43
NVNT	ax80	5530	Ant1	77.448
NVNT	ax80	5610	Ant1	77.371
NVNT	ax80	5775	Ant1	77.423



NVNT	ax80	5210	Ant2	77.216
NVNT	ax80	5290	Ant2	77.225
NVNT	ax80	5530	Ant2	77.217
NVNT	ax80	5610	Ant2	77.071
NVNT	ax80	5775	Ant2	77.149