



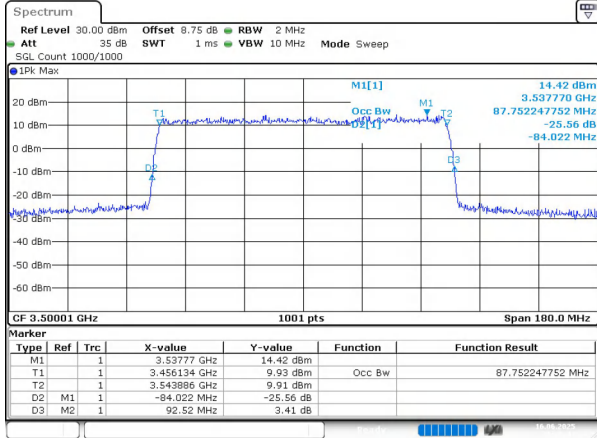


Date: 16.JUN.2025 16:13:41

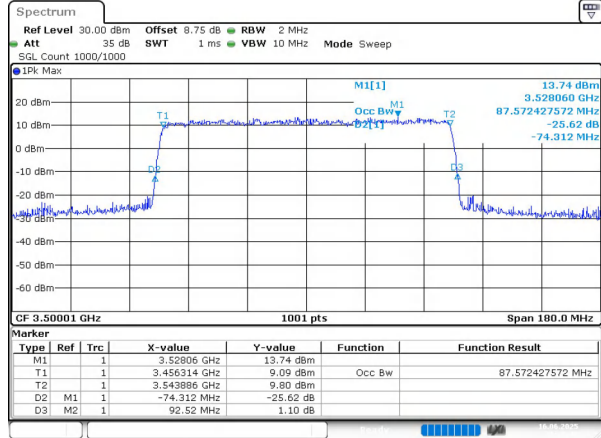


Date: 16.JUN.2025 16:13:48

n78(3450-3550) SCS=30kHz CP_16QAM BW=90MHz
Channel=633334 RB=245@0

n78(3450-3550) SCS=30kHz CP_64QAM BW=90MHz
Channel=633334 RB=245@0

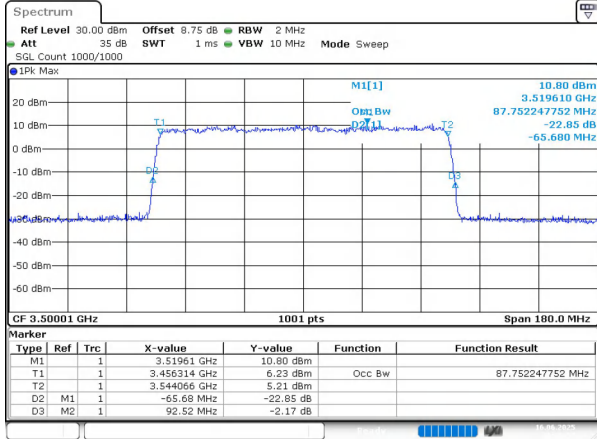


Date: 16.JUN.2025 16:13:58

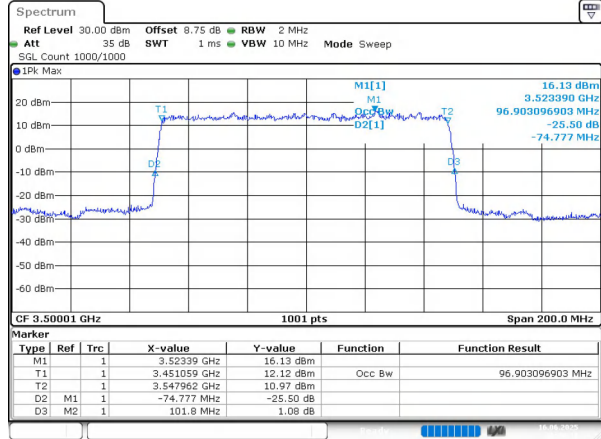


Date: 16.JUN.2025 16:14:11

n78(3450-3550) SCS=30kHz CP_256QAM BW=90MHz
Channel=633334 RB=245@0

n78(3450-3550) SCS=30kHz DFT_BPSK BW=100MHz
Channel=633334 RB=270@0

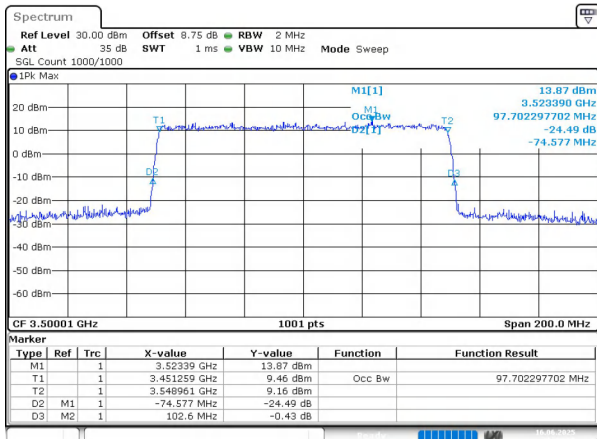


Date: 16.JUN.2025 16:14:21

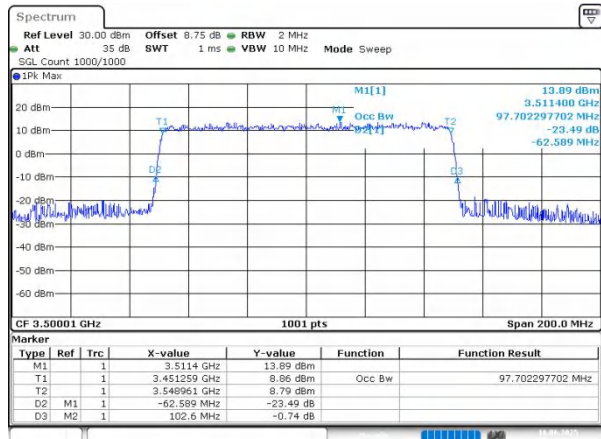


Date: 16.JUN.2025 16:14:27

n78(3450-3550) SCS=30kHz CP_QPSK BW=100MHz
Channel=633334 RB=273@0

n78(3450-3550) SCS=30kHz CP_16QAM BW=100MHz
Channel=633334 RB=273@0

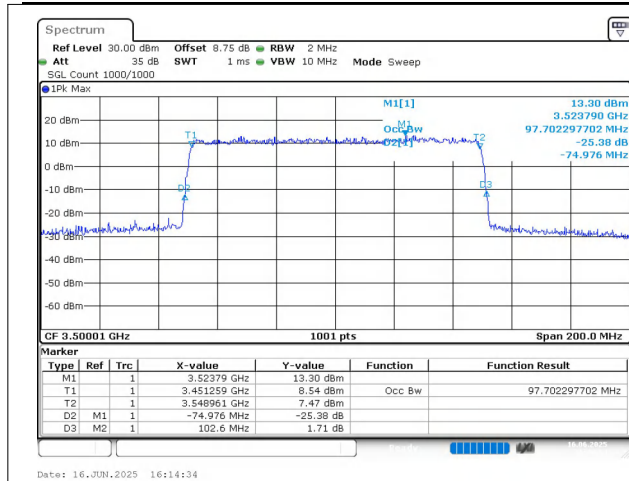


n78(3450-3550) SCS=30kHz CP_64QAM BW=100MHz
Channel=633334 RB=273@0

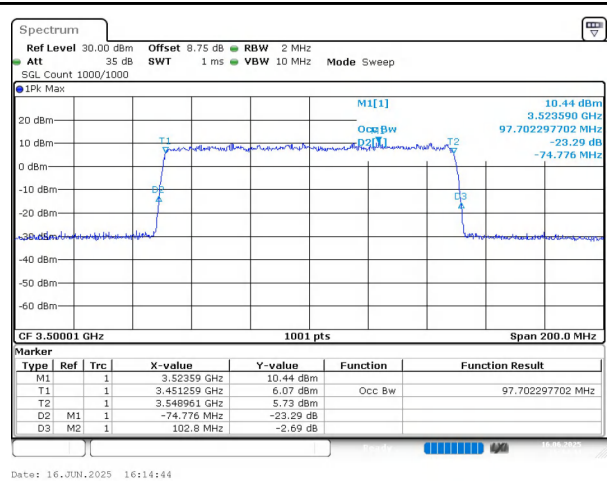


n78(3450-3550) SCS=30kHz CP_256QAM BW=100MHz
Channel=633334 RB=273@0

5. Conducted Band Edge

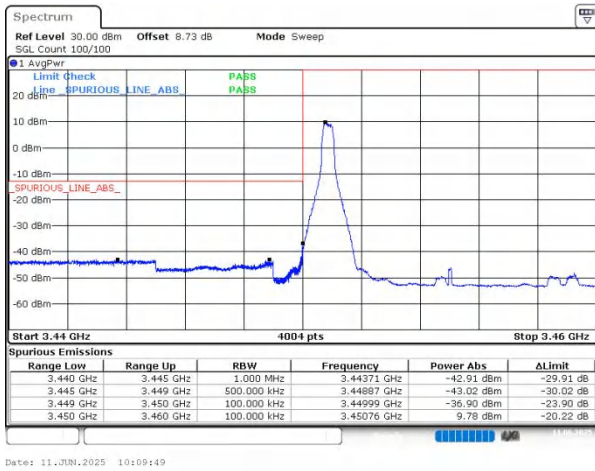


n78(3450-3550) SCS=30kHz DFT_BPSK BW=10MHz

LowChannel=630334 RB=1@0

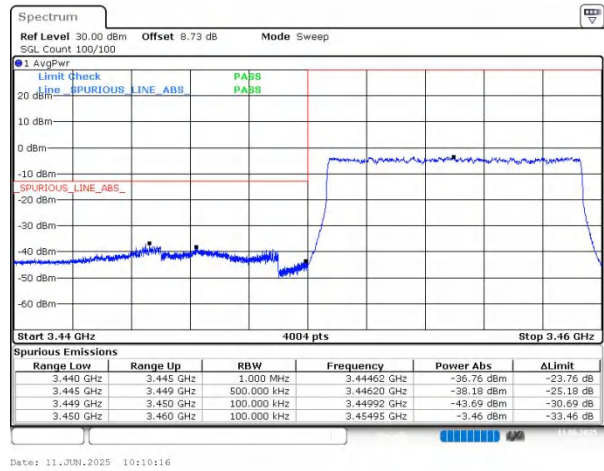


n78(3450-3550) SCS=30kHz DFT_BPSK BW=10MHz

LowChannel=630334 RB=24@0

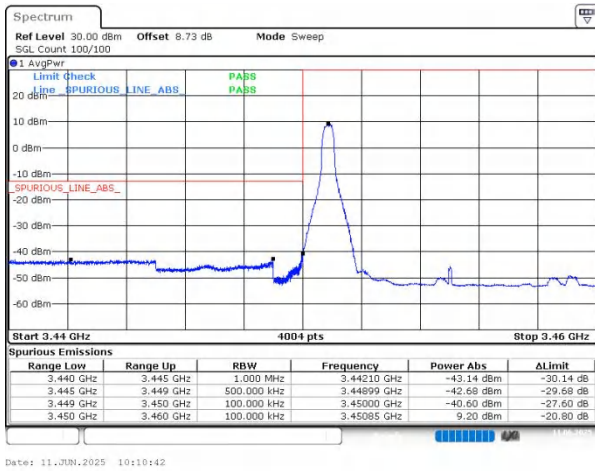


n78(3450-3550) SCS=30kHz DFT_QPSK BW=10MHz

LowChannel=630334 RB=1@0

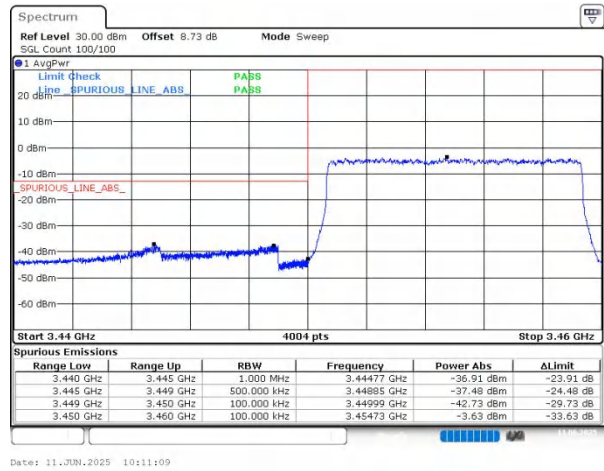


n78(3450-3550) SCS=30kHz DFT_QPSK BW=10MHz

LowChannel=630334 RB=24@0

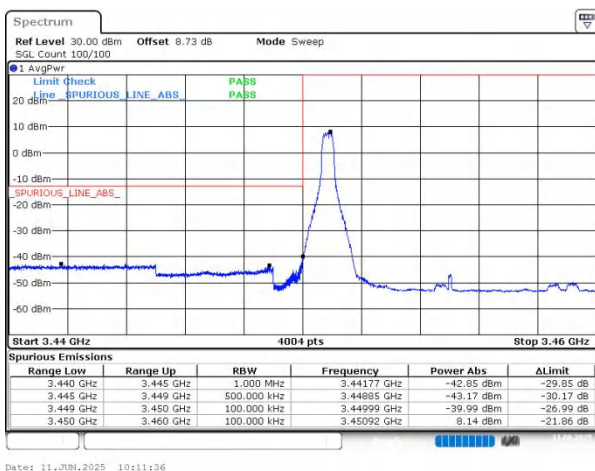


n78(3450-3550) SCS=30kHz DFT_16QAM BW=10MHz

LowChannel=630334 RB=1@0

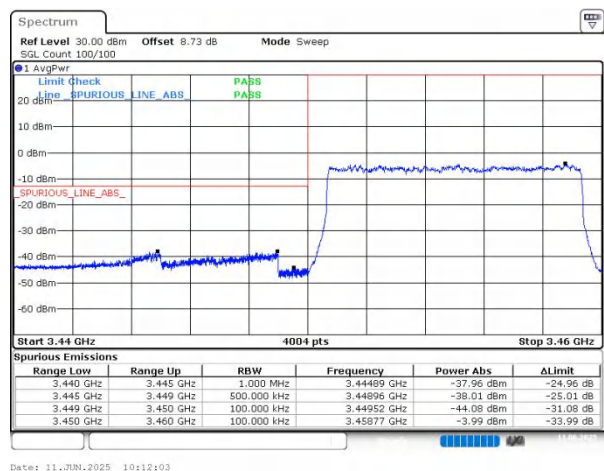


n78(3450-3550) SCS=30kHz DFT_16QAM BW=10MHz

LowChannel=630334 RB=24@0

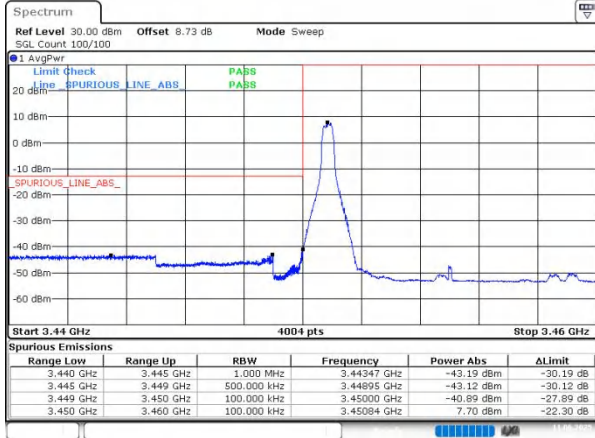


Date: 11.JUN.2025 10:12:29

n78(3450-3550) SCS=30kHz DFT_64QAM BW=10MHz
LowChannel=630334 RB=1@0

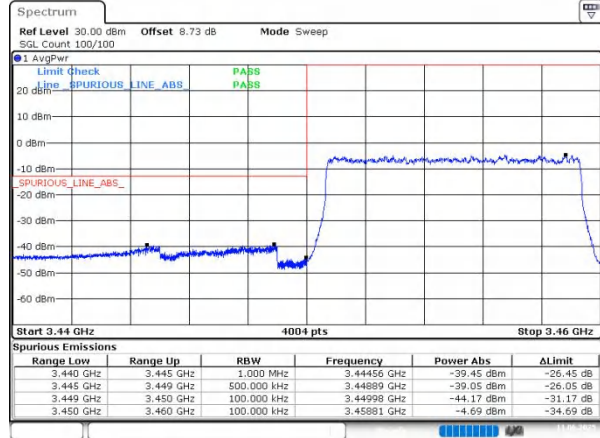


Date: 11.JUN.2025 10:12:56

n78(3450-3550) SCS=30kHz DFT_64QAM BW=10MHz
LowChannel=630334 RB=24@0

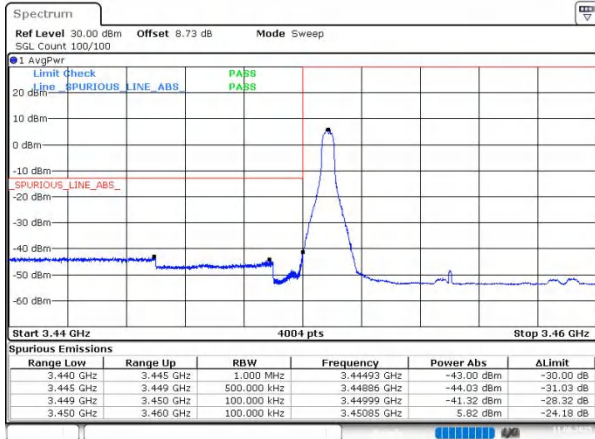


Date: 11.JUN.2025 10:13:25

n78(3450-3550) SCS=30kHz DFT_256QAM BW=10MHz
LowChannel=630334 RB=1@0

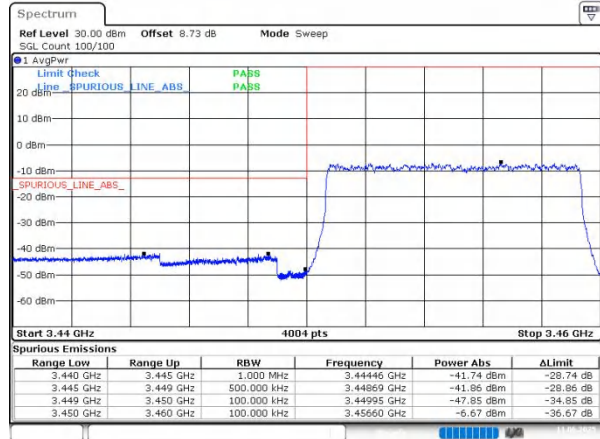


Date: 11.JUN.2025 10:13:52

n78(3450-3550) SCS=30kHz DFT_256QAM BW=10MHz
LowChannel=630334 RB=24@0

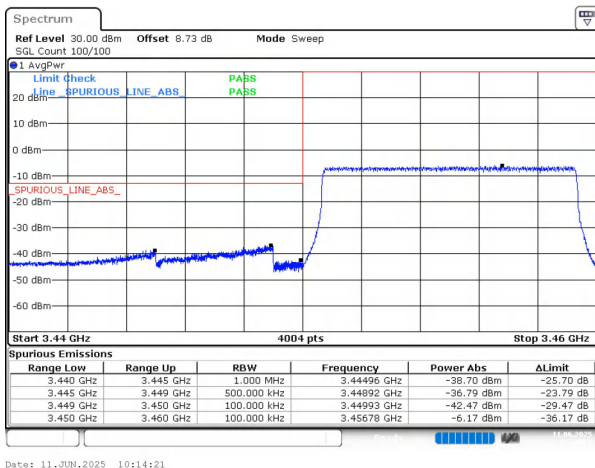


Date: 11.JUN.2025 10:14:21

n78(3450-3550) SCS=30kHz CP_QPSK BW=10MHz
LowChannel=630334 RB=24@0

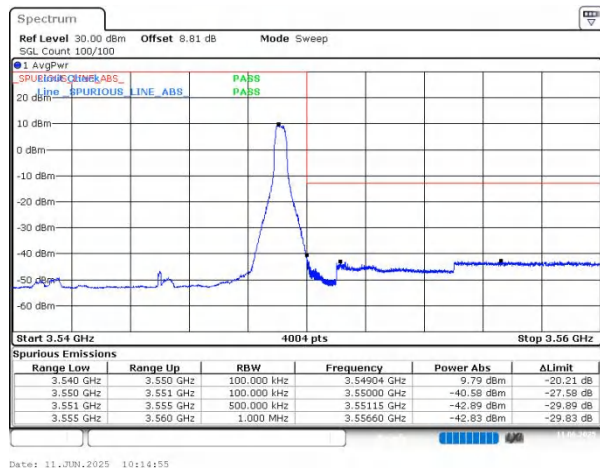


Date: 11.JUN.2025 10:14:55


n78(3450-3550) SCS=30kHz DFT_BPSK BW=10MHz
HighChannel=636332 RB=1@23

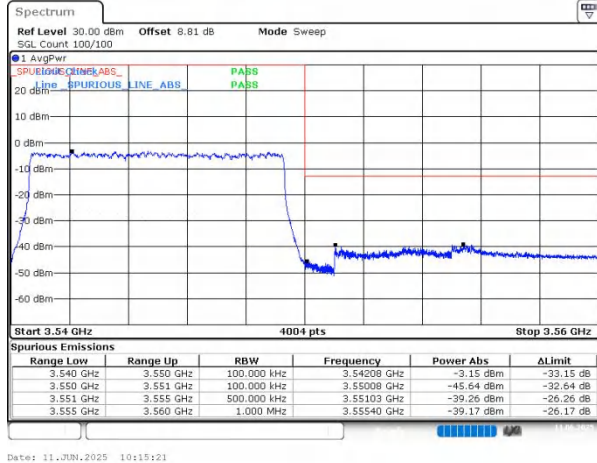


n78(3450-3550) SCS=30kHz DFT_BPSK BW=10MHz
HighChannel=636332 RB=24@0

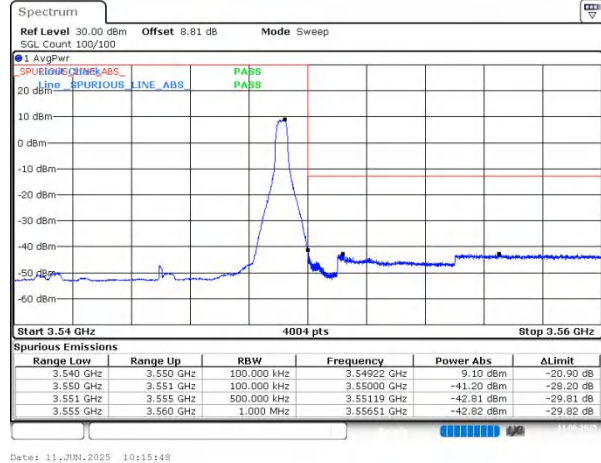


n78(3450-3550) SCS=30kHz DFT_QPSK BW=10MHz
HighChannel=636332 RB=1@23

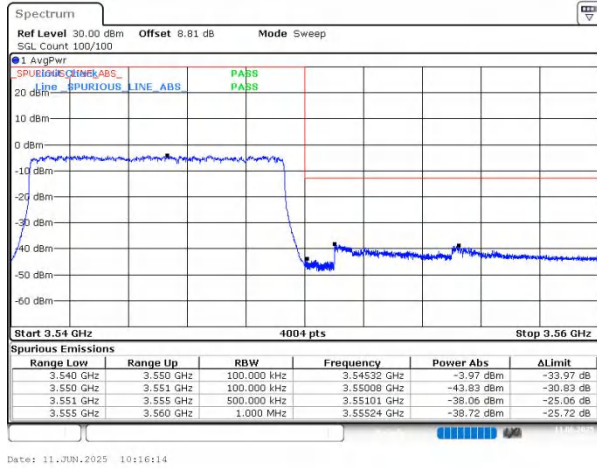


n78(3450-3550) SCS=30kHz DFT_QPSK BW=10MHz
HighChannel=636332 RB=24@0

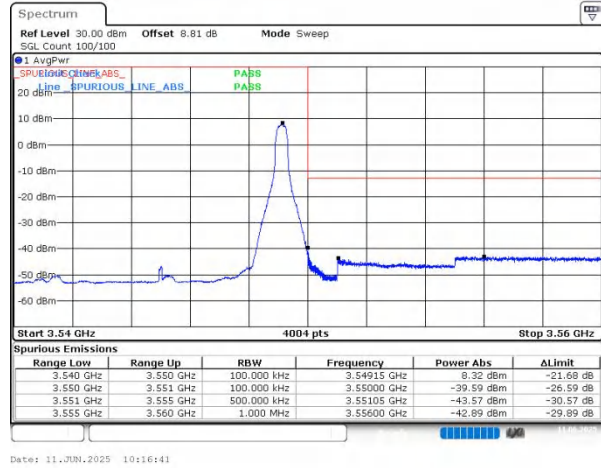


n78(3450-3550) SCS=30kHz DFT_16QAM BW=10MHz
HighChannel=636332 RB=1@23

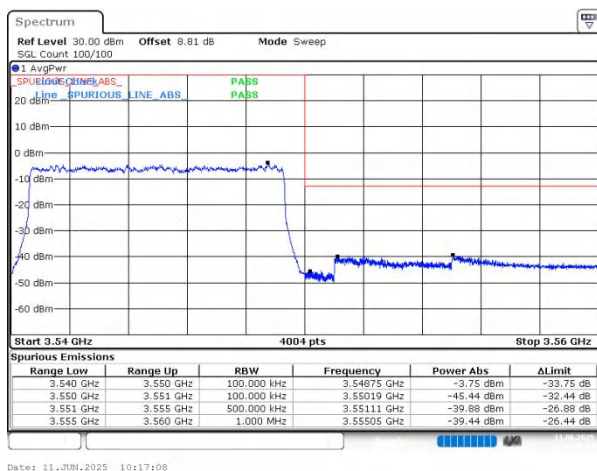


n78(3450-3550) SCS=30kHz DFT_16QAM BW=10MHz
HighChannel=636332 RB=24@0

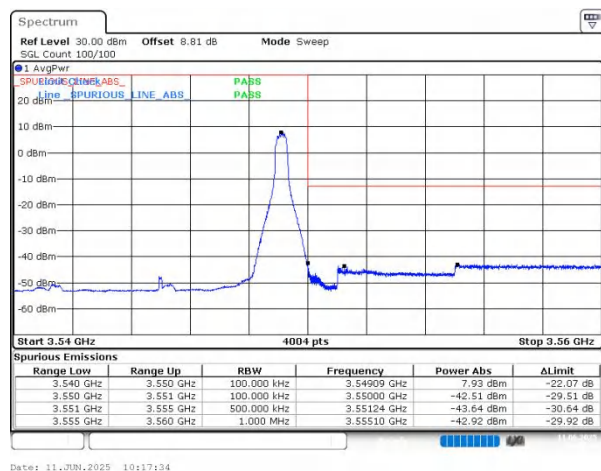


n78(3450-3550) SCS=30kHz DFT_64QAM BW=10MHz
HighChannel=636332 RB=1@23

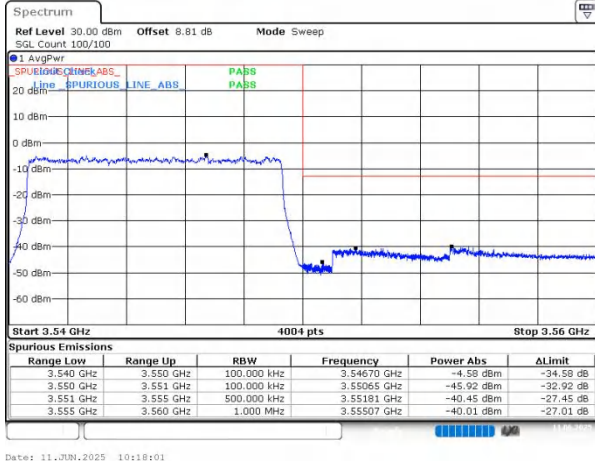


n78(3450-3550) SCS=30kHz DFT_64QAM BW=10MHz
HighChannel=636332 RB=24@0

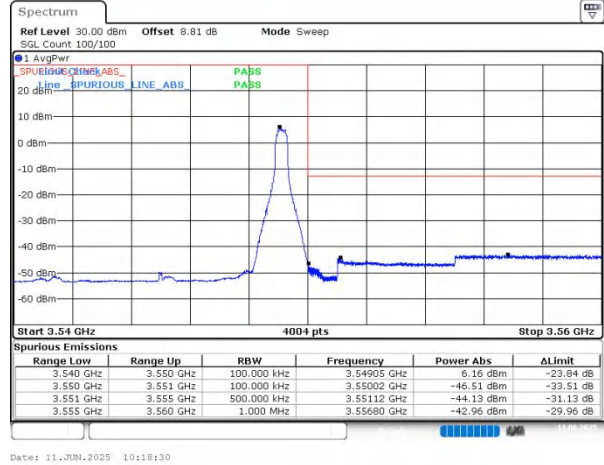


n78(3450-3550) SCS=30kHz DFT_256QAM BW=10MHz
HighChannel=636332 RB=1@23

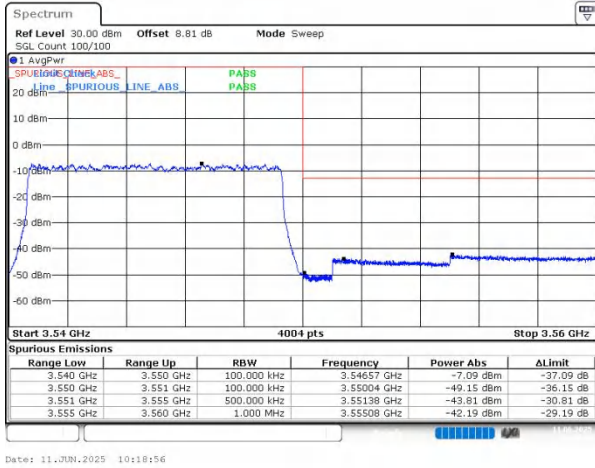


n78(3450-3550) SCS=30kHz DFT_256QAM BW=10MHz
HighChannel=636332 RB=24@0

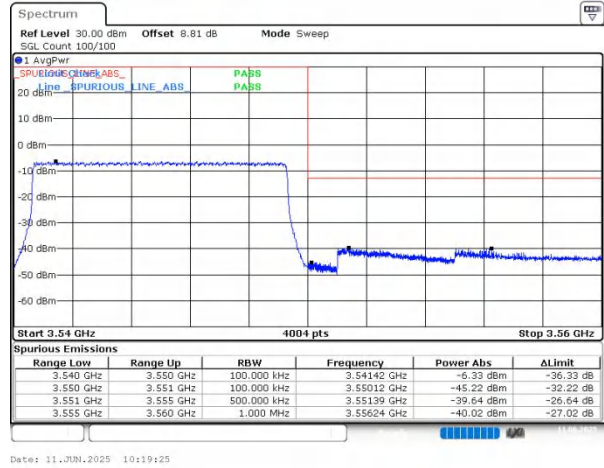


n78(3450-3550) SCS=30kHz CP_QPSK BW=10MHz
HighChannel=636332 RB=24@0

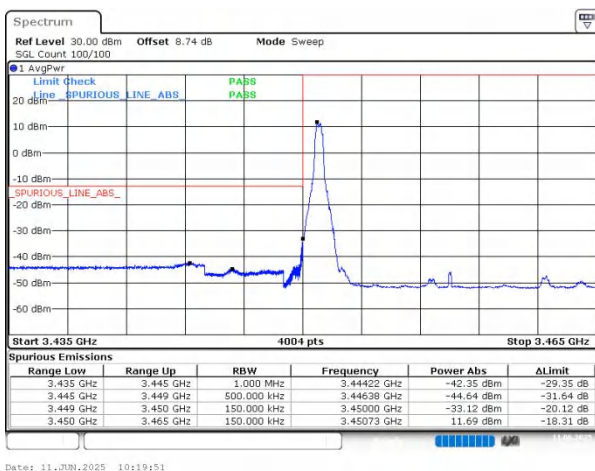

n78(3450-3550) SCS=30kHz DFT_BPSK BW=15MHz
LowChannel=630500 RB=1@0

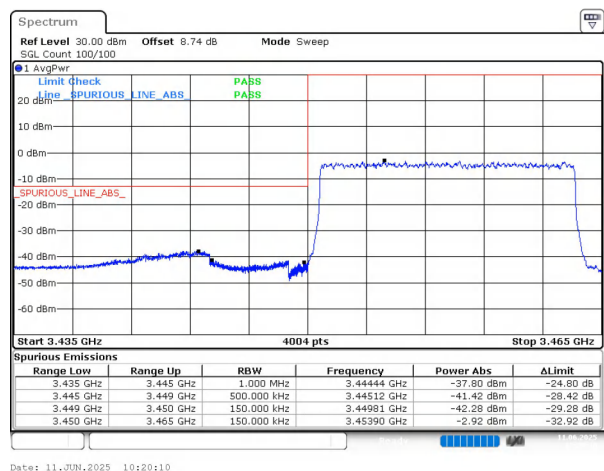


n78(3450-3550) SCS=30kHz DFT_BPSK BW=15MHz
LowChannel=630500 RB=36@0

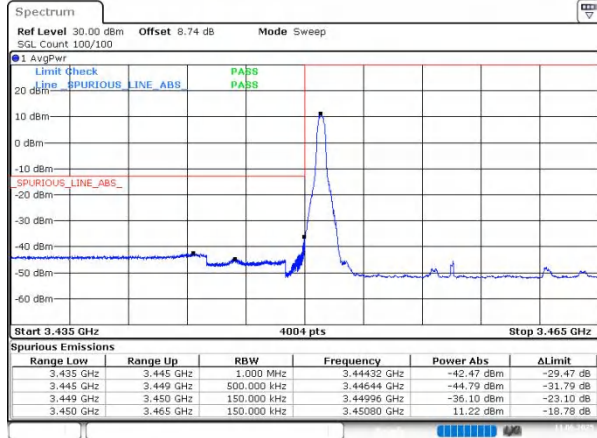


Date: 11.JUN.2025 10:20:29

n78(3450-3550) SCS=30kHz DFT_QPSK BW=15MHz
LowChannel=630500 RB=1@0

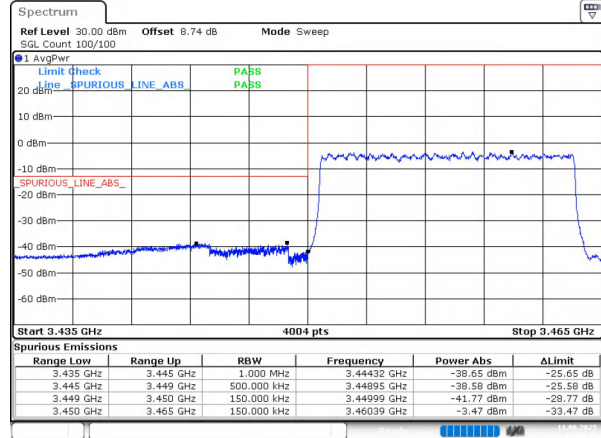


Date: 11.JUN.2025 10:20:47

n78(3450-3550) SCS=30kHz DFT_QPSK BW=15MHz
LowChannel=630500 RB=36@0

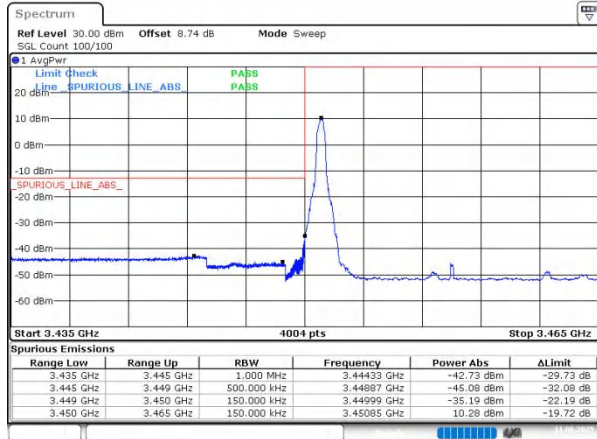


Date: 11.JUN.2025 10:21:06

n78(3450-3550) SCS=30kHz DFT_16QAM BW=15MHz
LowChannel=630500 RB=1@0

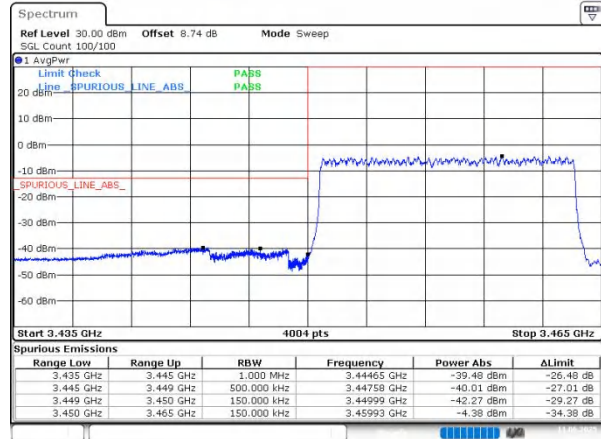


Date: 11.JUN.2025 10:21:25

n78(3450-3550) SCS=30kHz DFT_16QAM BW=15MHz
LowChannel=630500 RB=36@0

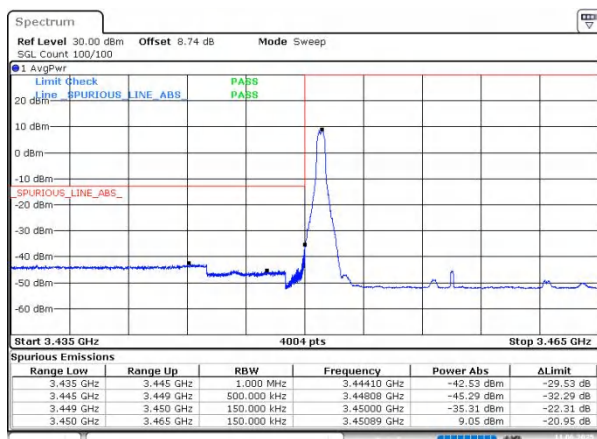


Date: 11.JUN.2025 10:21:44

n78(3450-3550) SCS=30kHz DFT_64QAM BW=15MHz
LowChannel=630500 RB=1@0

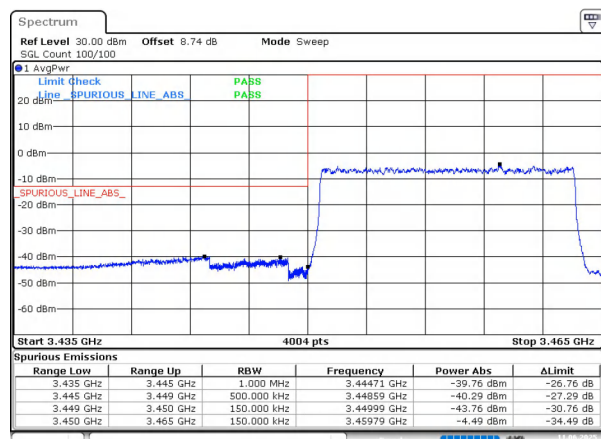


Date: 11.JUN.2025 10:22:02

n78(3450-3550) SCS=30kHz DFT_64QAM BW=15MHz
LowChannel=630500 RB=36@0

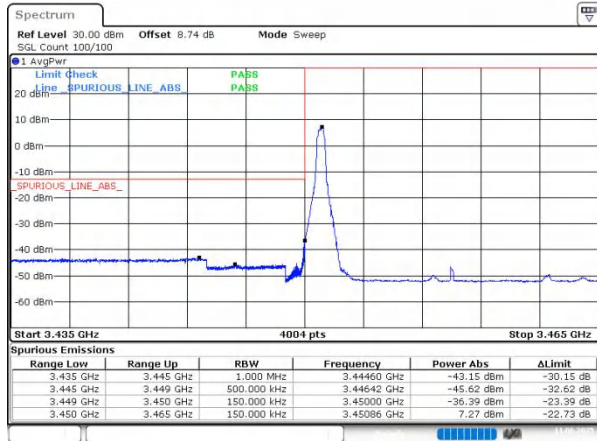


Date: 11.JUN.2025 10:22:24

n78(3450-3550) SCS=30kHz DFT_256QAM BW=15MHz
LowChannel=630500 RB=1@0

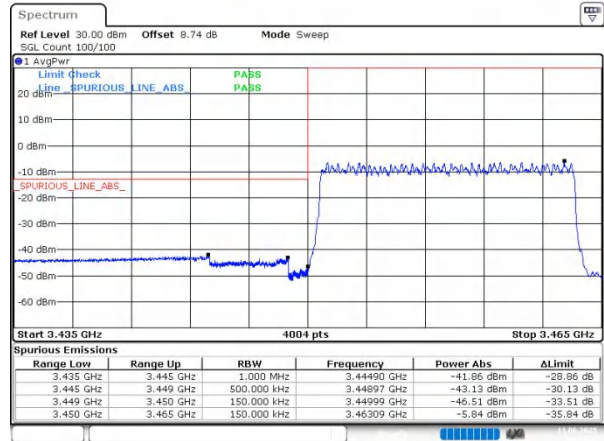


Date: 11.JUN.2025 10:22:43

n78(3450-3550) SCS=30kHz DFT_256QAM BW=15MHz
LowChannel=630500 RB=36@0

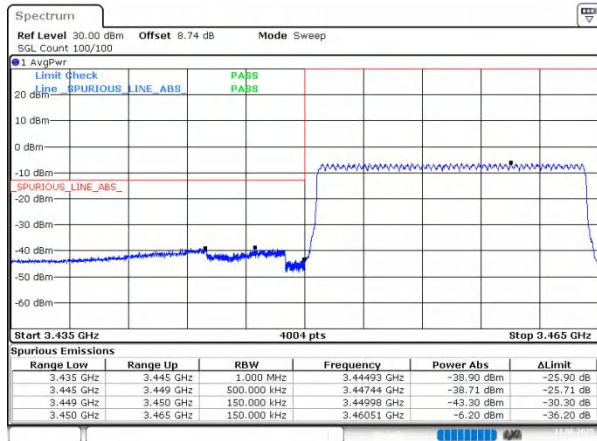


Date: 11.JUN.2025 10:23:04

n78(3450-3550) SCS=30kHz CP_QPSK BW=15MHz
LowChannel=630500 RB=38@0

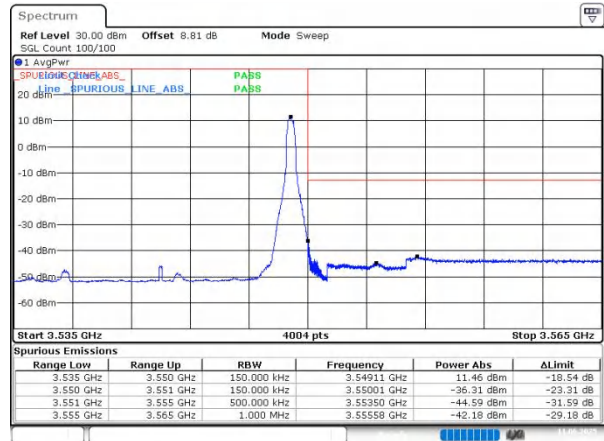


Date: 11.JUN.2025 10:23:33

n78(3450-3550) SCS=30kHz DFT_BPSK BW=15MHz
HighChannel=636166 RB=1@37

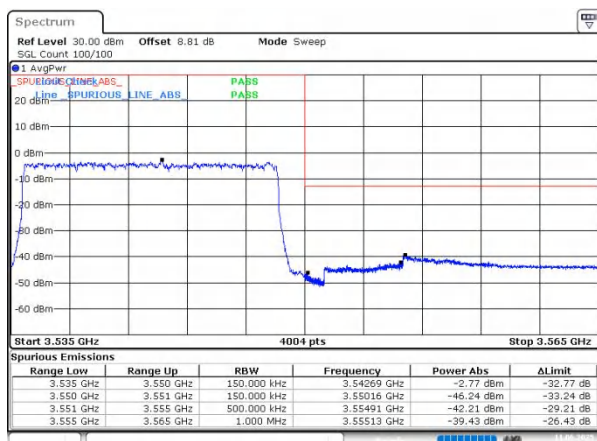


Date: 11.JUN.2025 10:23:52

n78(3450-3550) SCS=30kHz DFT_BPSK BW=15MHz
HighChannel=636166 RB=36@0

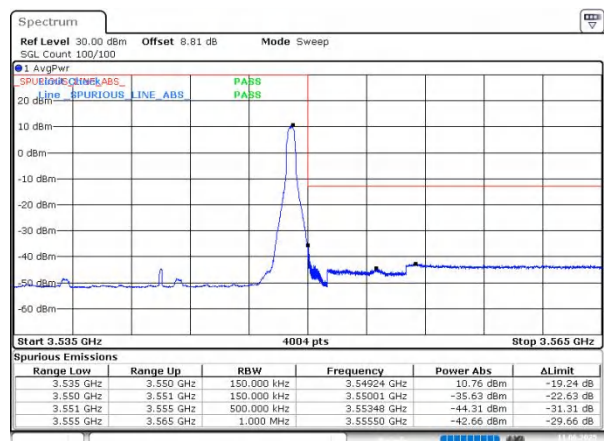


Date: 11.JUN.2025 10:24:11

n78(3450-3550) SCS=30kHz DFT_QPSK BW=15MHz
HighChannel=636166 RB=1@37

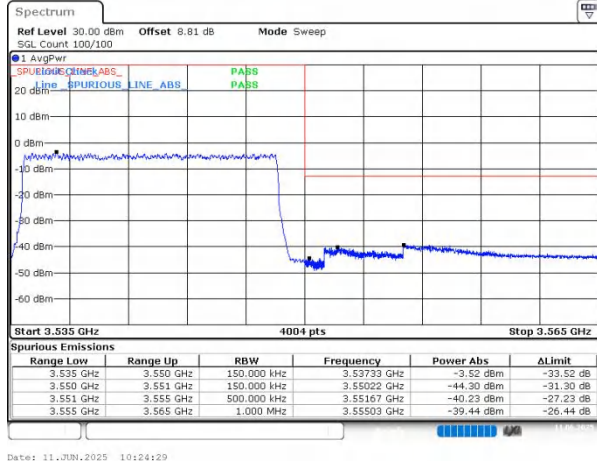


Date: 11.JUN.2025 10:24:29

n78(3450-3550) SCS=30kHz DFT_QPSK BW=15MHz
HighChannel=636166 RB=36@0

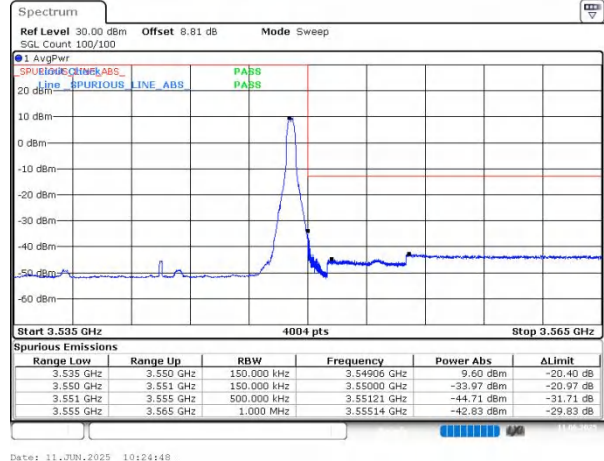


Date: 11.JUN.2025 10:24:48

n78(3450-3550) SCS=30kHz DFT_16QAM BW=15MHz
HighChannel=636166 RB=1@37

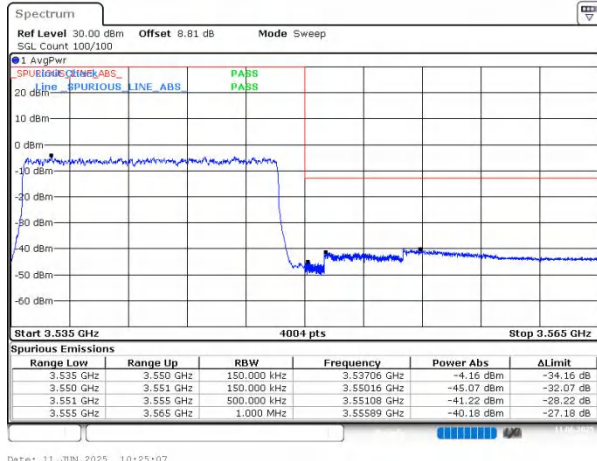


Date: 11.JUN.2025 10:25:07

n78(3450-3550) SCS=30kHz DFT_16QAM BW=15MHz
HighChannel=636166 RB=36@0

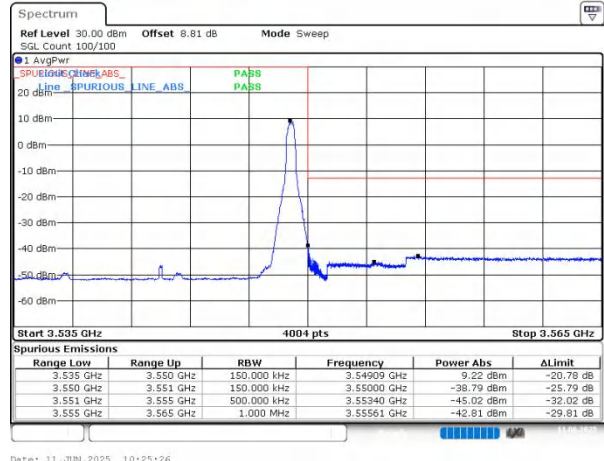


Date: 11.JUN.2025 10:25:26

n78(3450-3550) SCS=30kHz DFT_64QAM BW=15MHz
HighChannel=636166 RB=1@37

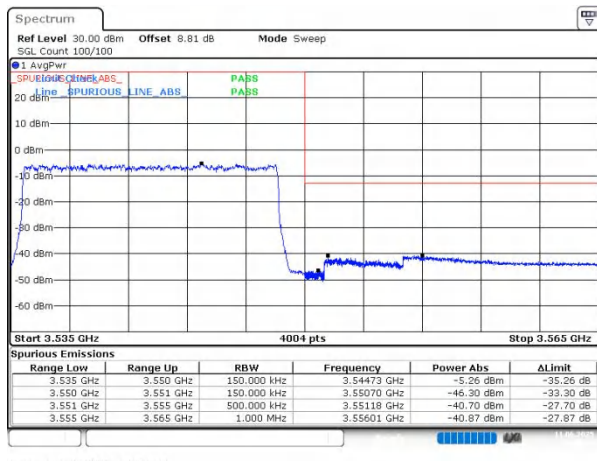


Date: 11.JUN.2025 10:25:44

n78(3450-3550) SCS=30kHz DFT_64QAM BW=15MHz
HighChannel=636166 RB=36@0

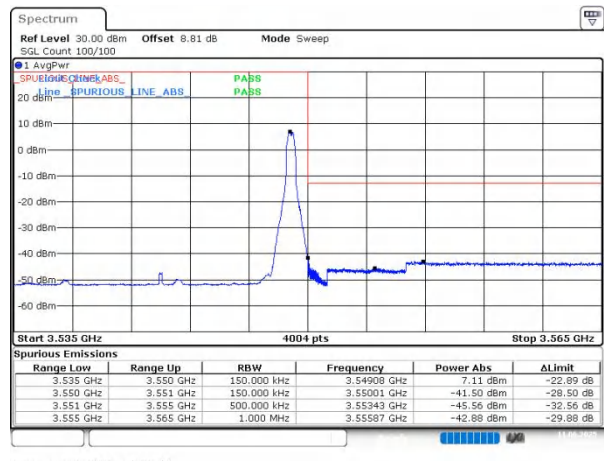


Date: 11.JUN.2025 10:26:06


n78(3450-3550) SCS=30kHz DFT_256QAM BW=15MHz
HighChannel=636166 RB=1@37

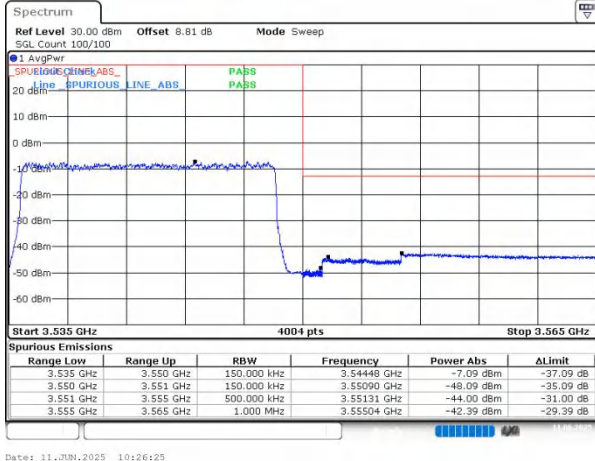


n78(3450-3550) SCS=30kHz DFT_256QAM BW=15MHz
HighChannel=636166 RB=36@0

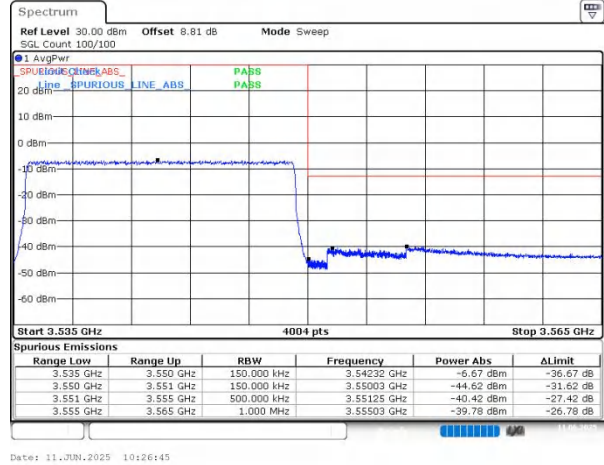


n78(3450-3550) SCS=30kHz CP_QPSK BW=15MHz
HighChannel=636166 RB=38@0

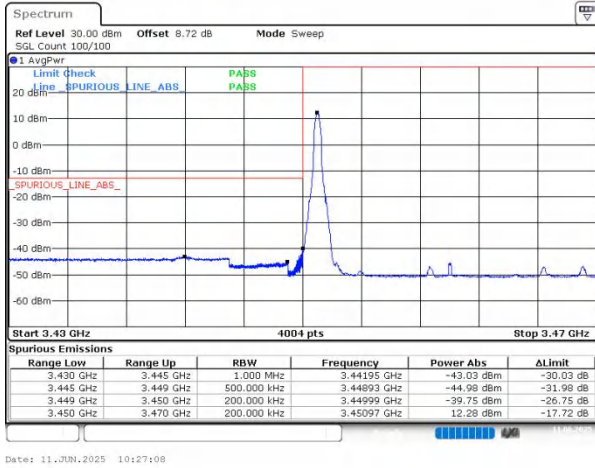


n78(3450-3550) SCS=30kHz DFT_BPSK BW=20MHz
LowChannel=630668 RB=1@0

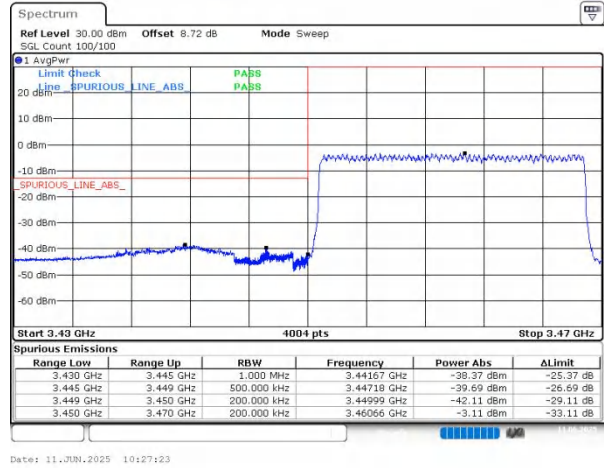


n78(3450-3550) SCS=30kHz DFT_BPSK BW=20MHz
LowChannel=630668 RB=50@0

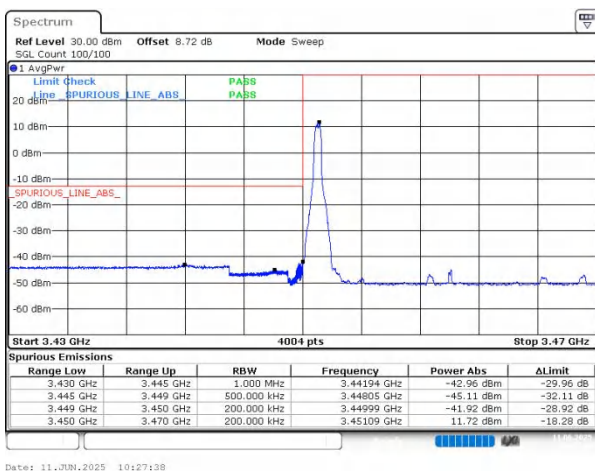


n78(3450-3550) SCS=30kHz DFT_QPSK BW=20MHz
LowChannel=630668 RB=1@0

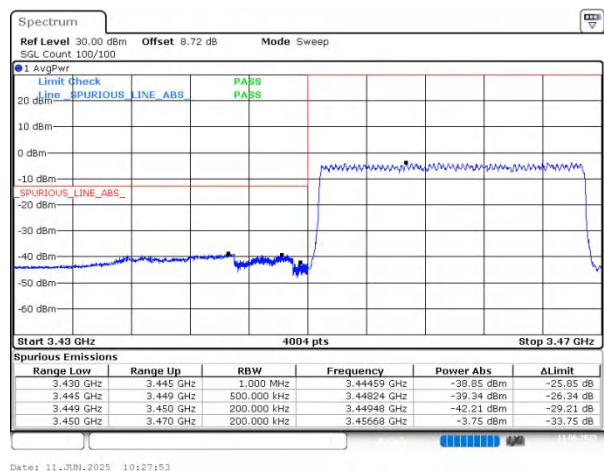


n78(3450-3550) SCS=30kHz DFT_QPSK BW=20MHz
LowChannel=630668 RB=50@0

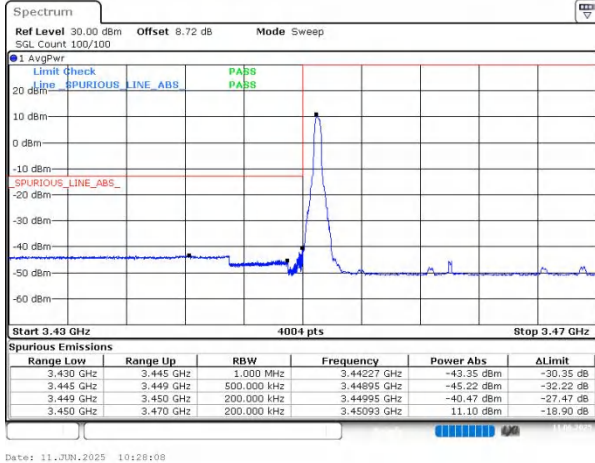


n78(3450-3550) SCS=30kHz DFT_16QAM BW=20MHz
LowChannel=630668 RB=1@0

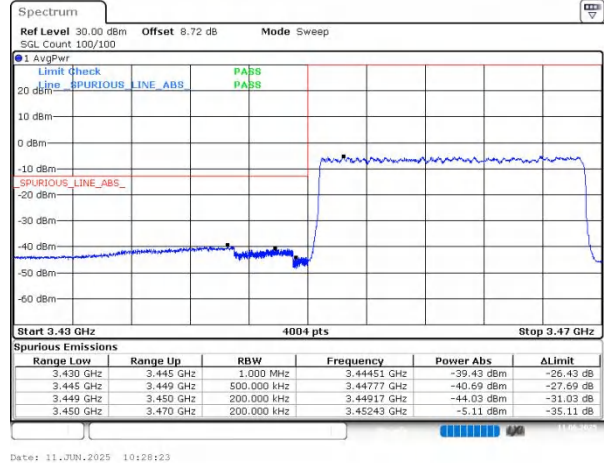


n78(3450-3550) SCS=30kHz DFT_16QAM BW=20MHz
LowChannel=630668 RB=50@0

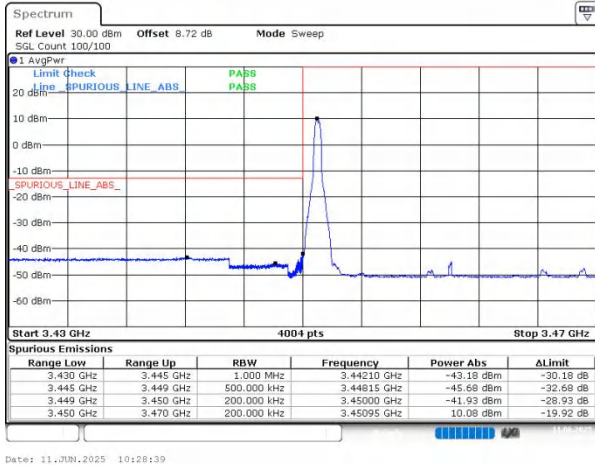


n78(3450-3550) SCS=30kHz DFT_64QAM BW=20MHz
LowChannel=630668 RB=1@0

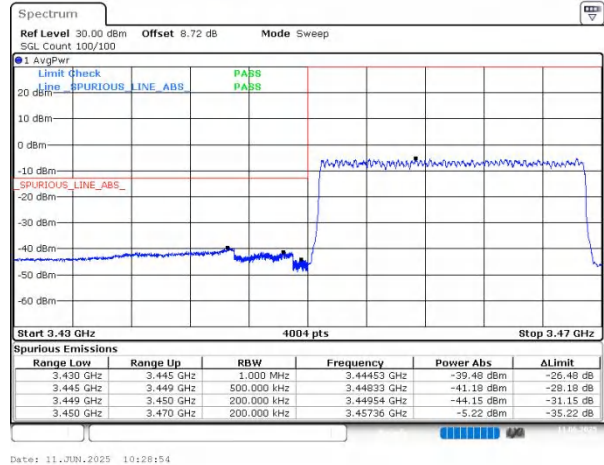


n78(3450-3550) SCS=30kHz DFT_64QAM BW=20MHz
LowChannel=630668 RB=50@0

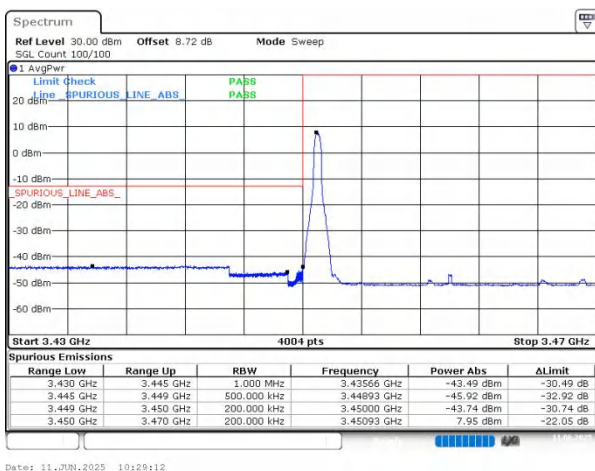


n78(3450-3550) SCS=30kHz DFT_256QAM BW=20MHz
LowChannel=630668 RB=1@0

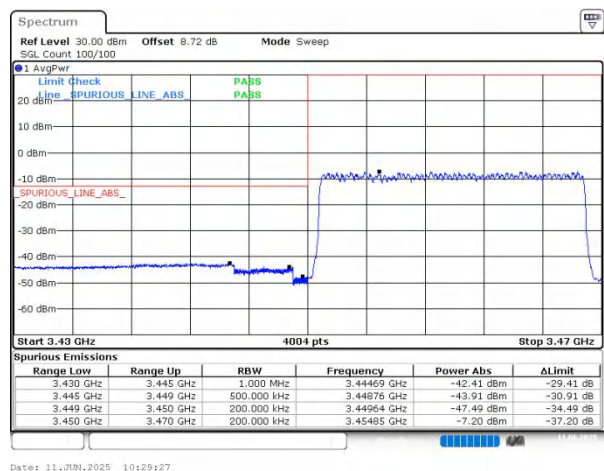


n78(3450-3550) SCS=30kHz DFT_256QAM BW=20MHz
LowChannel=630668 RB=50@0

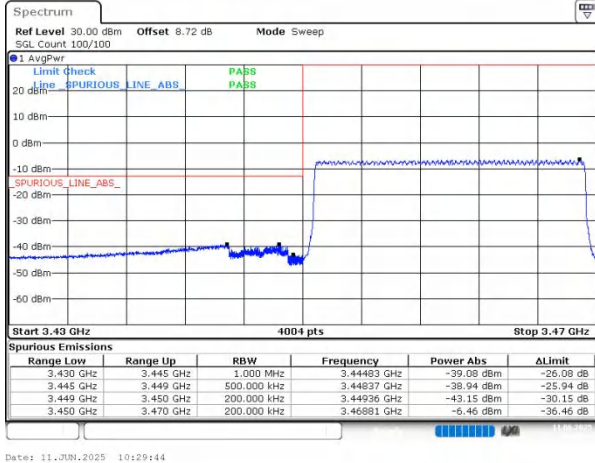


n78(3450-3550) SCS=30kHz CP_QPSK BW=20MHz
LowChannel=630668 RB=51@0

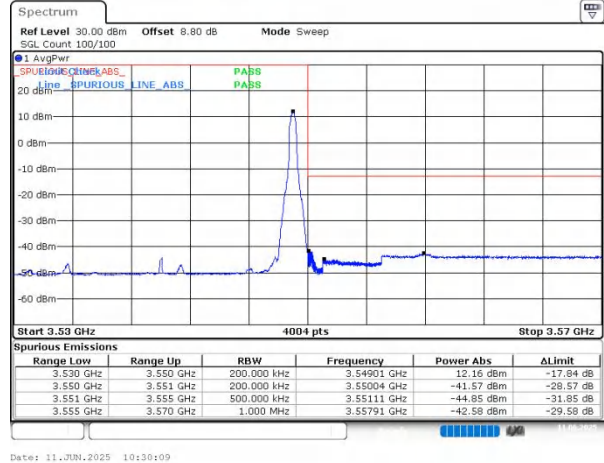


n78(3450-3550) SCS=30kHz DFT_BPSK BW=20MHz
HighChannel=636000 RB=1@50

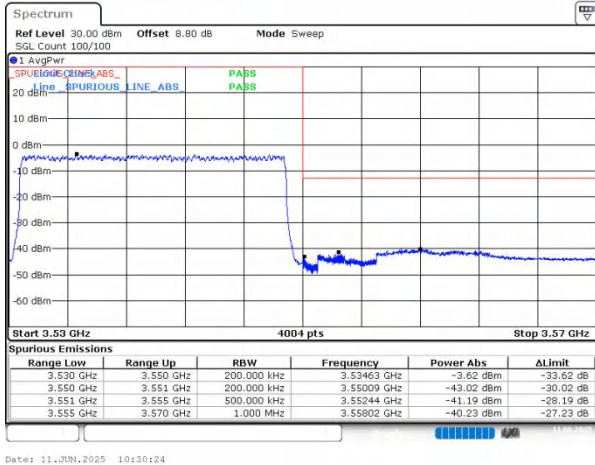


n78(3450-3550) SCS=30kHz DFT_BPSK BW=20MHz
HighChannel=636000 RB=50@0

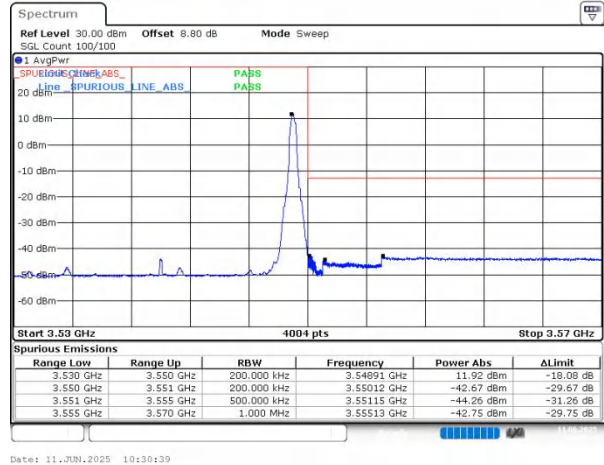


n78(3450-3550) SCS=30kHz DFT_QPSK BW=20MHz
HighChannel=636000 RB=1@50

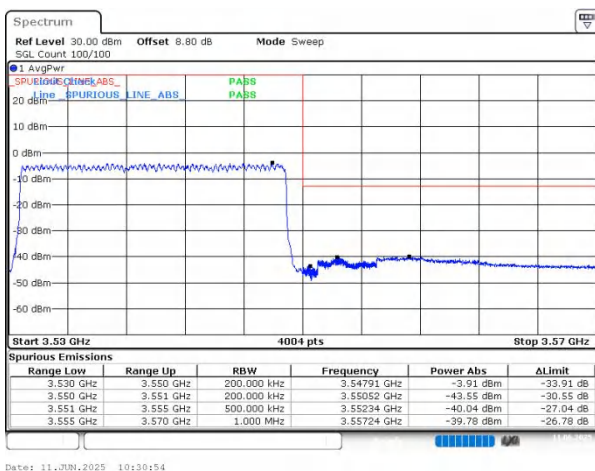


n78(3450-3550) SCS=30kHz DFT_QPSK BW=20MHz
HighChannel=636000 RB=50@0

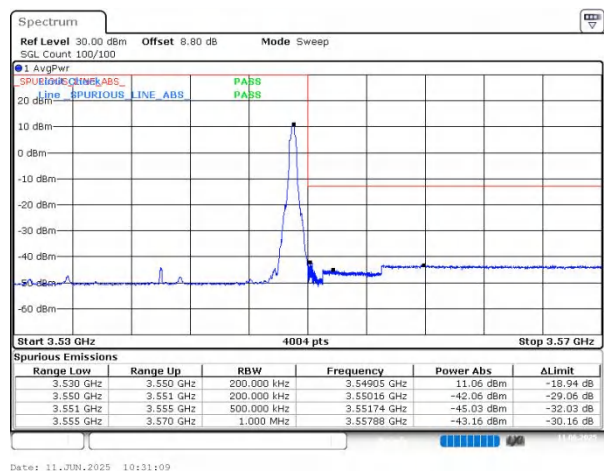


n78(3450-3550) SCS=30kHz DFT_16QAM BW=20MHz
HighChannel=636000 RB=1@50

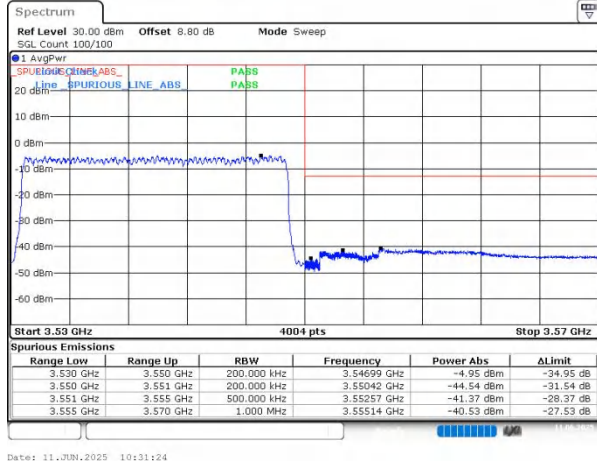


n78(3450-3550) SCS=30kHz DFT_16QAM BW=20MHz
HighChannel=636000 RB=50@0

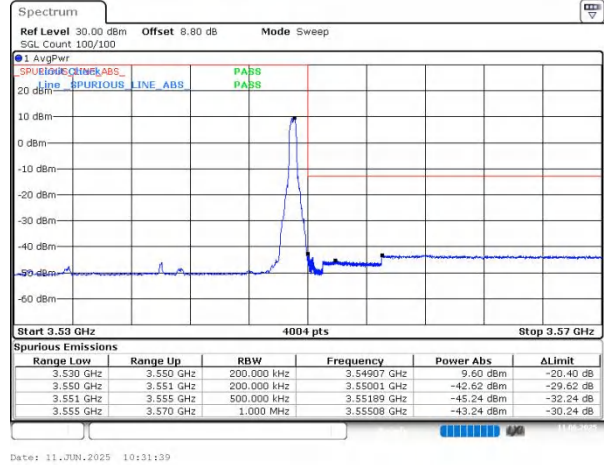


n78(3450-3550) SCS=30kHz DFT_64QAM BW=20MHz
HighChannel=636000 RB=1@50

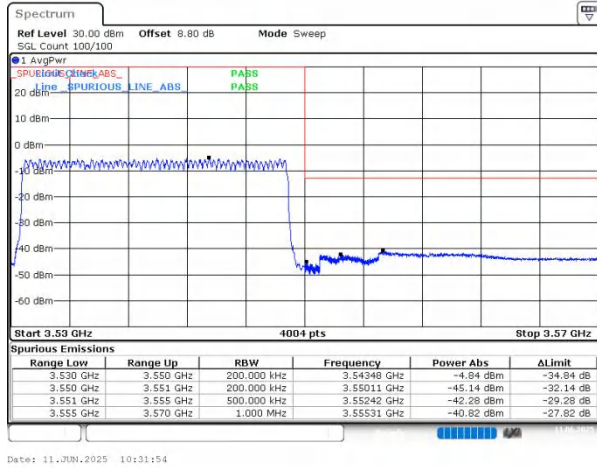


n78(3450-3550) SCS=30kHz DFT_64QAM BW=20MHz
HighChannel=636000 RB=50@0

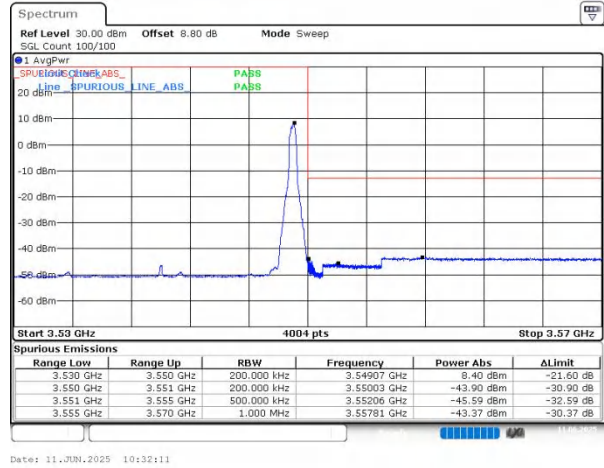


n78(3450-3550) SCS=30kHz DFT_256QAM BW=20MHz
HighChannel=636000 RB=1@50

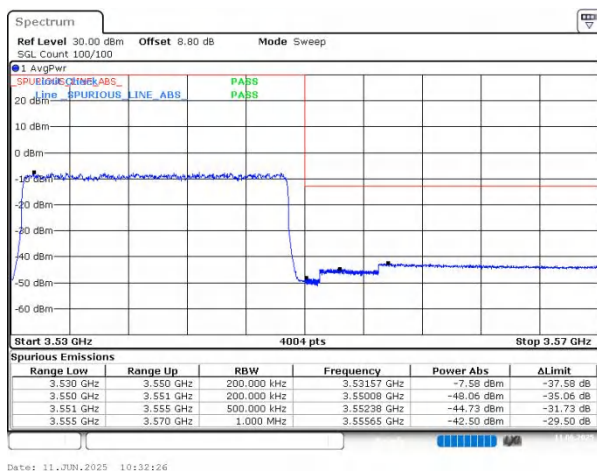

n78(3450-3550) SCS=30kHz DFT_256QAM BW=20MHz
HighChannel=636000 RB=50@0

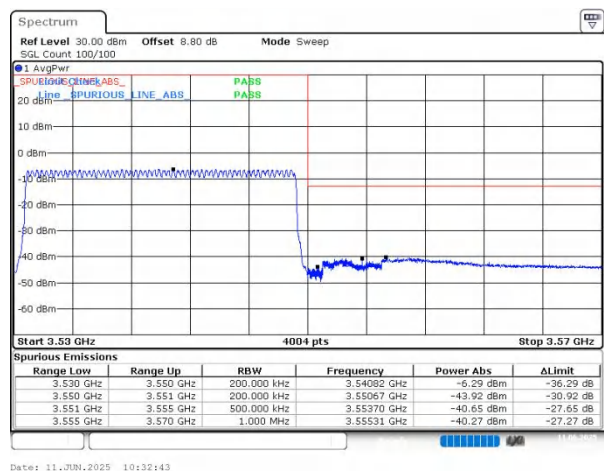


n78(3450-3550) SCS=30kHz CP_QPSK BW=20MHz
HighChannel=636000 RB=51@0

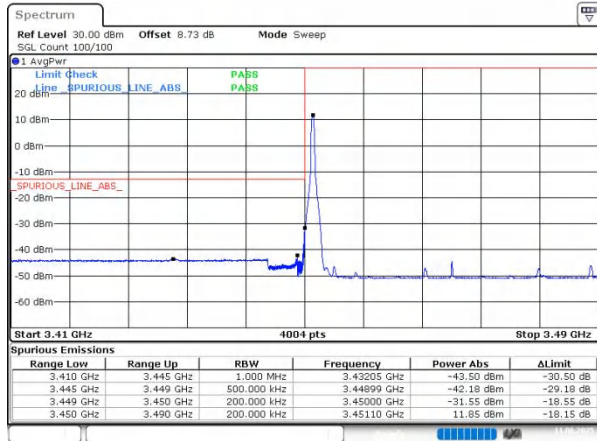


Date: 11.JUN.2025 10:33:19

n78(3450-3550) SCS=30kHz DFT_BPSK BW=40MHz
LowChannel=631334 RB=1@0

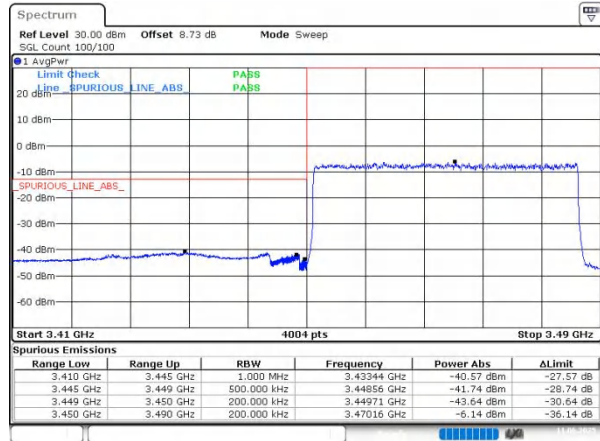


Date: 11.JUN.2025 10:33:46

n78(3450-3550) SCS=30kHz DFT_BPSK BW=40MHz
LowChannel=631334 RB=100@0

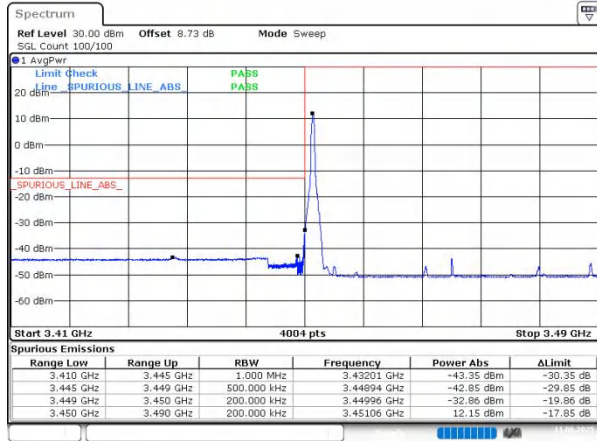


Date: 11.JUN.2025 10:34:12

n78(3450-3550) SCS=30kHz DFT_QPSK BW=40MHz
LowChannel=631334 RB=1@0

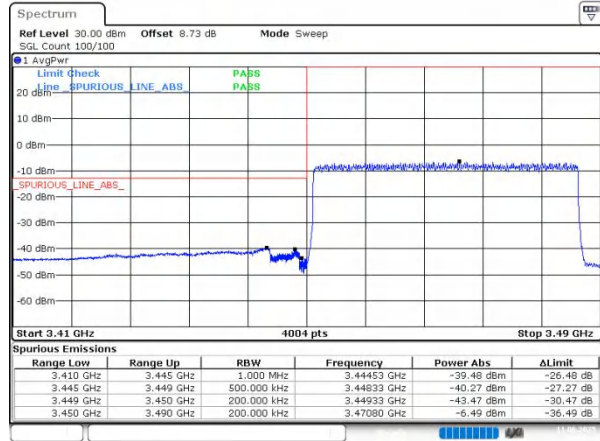


Date: 11.JUN.2025 10:34:39

n78(3450-3550) SCS=30kHz DFT_QPSK BW=40MHz
LowChannel=631334 RB=100@0

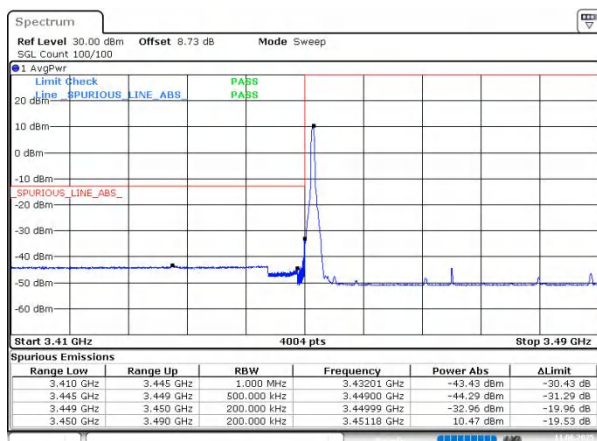


Date: 11.JUN.2025 10:35:06

n78(3450-3550) SCS=30kHz DFT_16QAM BW=40MHz
LowChannel=631334 RB=1@0

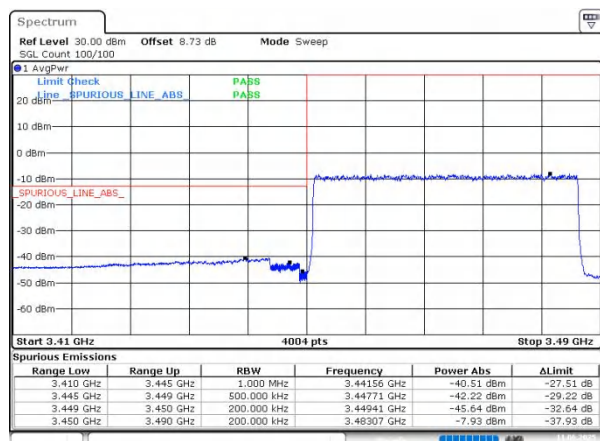


Date: 11.JUN.2025 10:35:32

n78(3450-3550) SCS=30kHz DFT_16QAM BW=40MHz
LowChannel=631334 RB=100@0

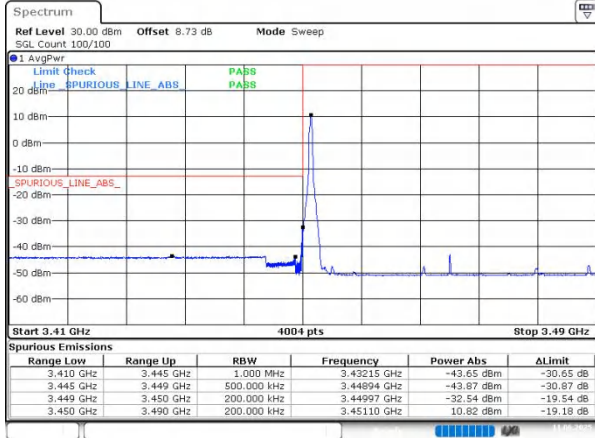


Date: 11.JUN.2025 10:35:59

n78(3450-3550) SCS=30kHz DFT_64QAM BW=40MHz
LowChannel=631334 RB=1@0

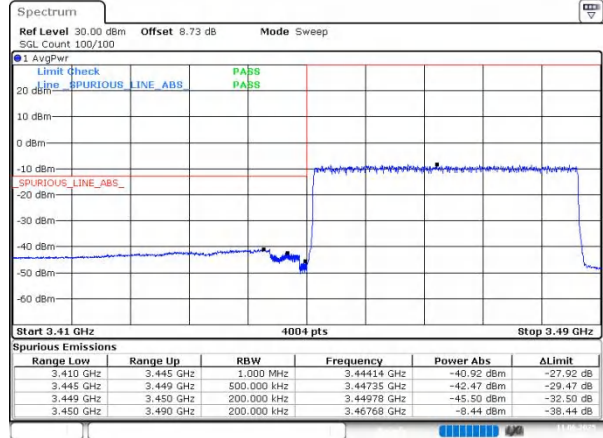


Date: 11.JUN.2025 10:36:25

n78(3450-3550) SCS=30kHz DFT_64QAM BW=40MHz
LowChannel=631334 RB=100@0

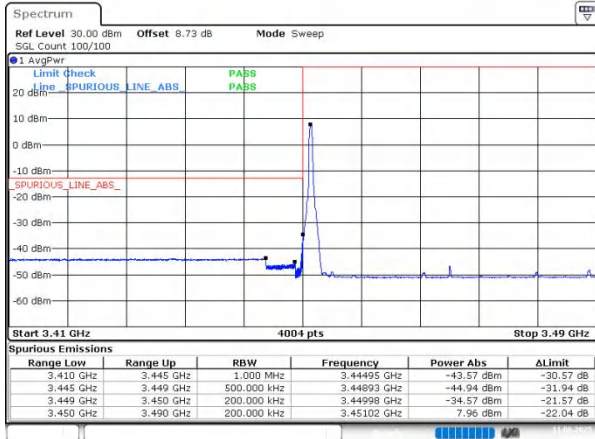


Date: 11.JUN.2025 10:36:54

n78(3450-3550) SCS=30kHz DFT_256QAM BW=40MHz
LowChannel=631334 RB=1@0

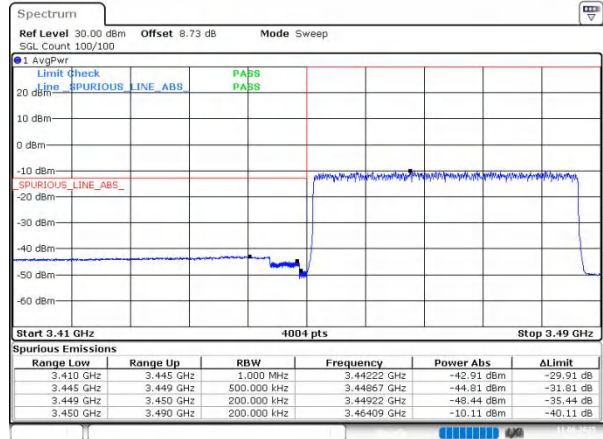


Date: 11.JUN.2025 10:37:21

n78(3450-3550) SCS=30kHz DFT_256QAM BW=40MHz
LowChannel=631334 RB=100@0

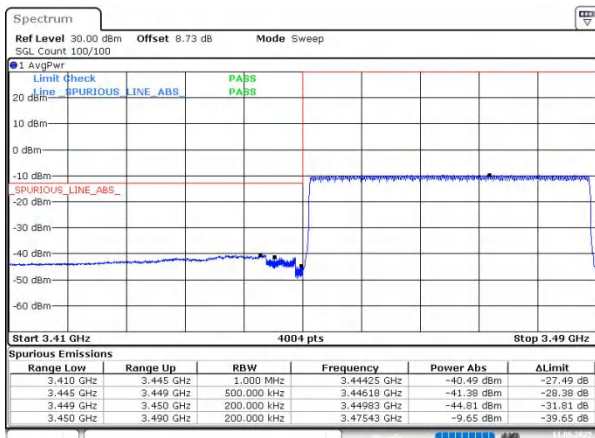


Date: 11.JUN.2025 10:37:49

n78(3450-3550) SCS=30kHz CP_QPSK BW=40MHz
LowChannel=631334 RB=106@0

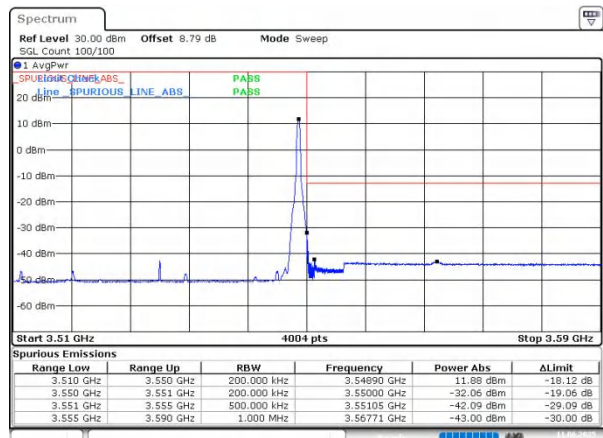


Date: 11.JUN.2025 10:38:27

n78(3450-3550) SCS=30kHz DFT_BPSK BW=40MHz
HighChannel=635332 RB=1@105

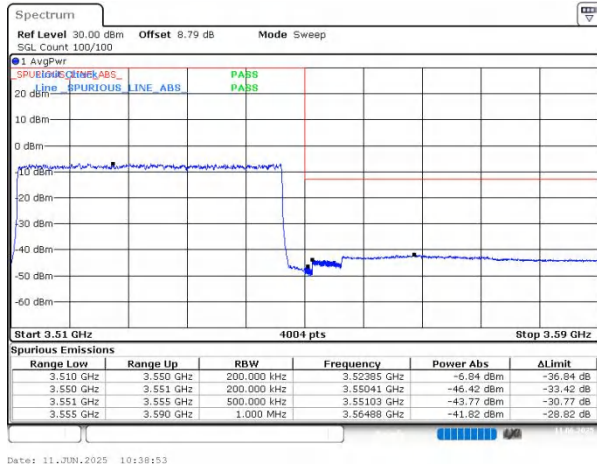


Date: 11.JUN.2025 10:38:53

n78(3450-3550) SCS=30kHz DFT_BPSK BW=40MHz
HighChannel=635332 RB=100@0

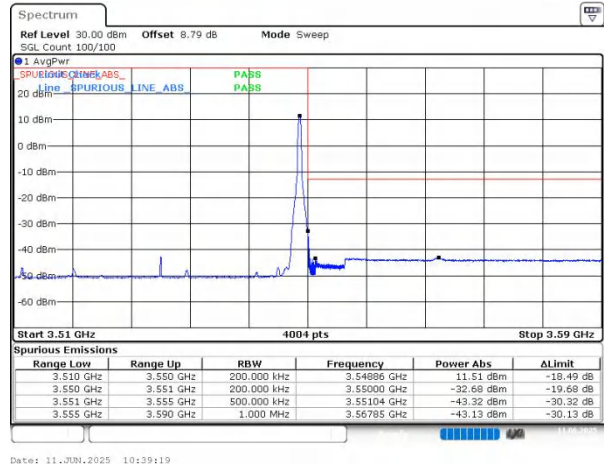


Date: 11.JUN.2025 10:39:19

n78(3450-3550) SCS=30kHz DFT_QPSK BW=40MHz
HighChannel=635332 RB=1@105

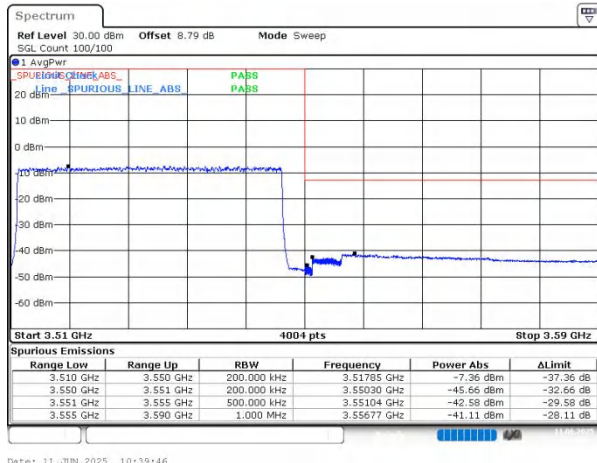


Date: 11.JUN.2025 10:39:46

n78(3450-3550) SCS=30kHz DFT_QPSK BW=40MHz
HighChannel=635332 RB=100@0

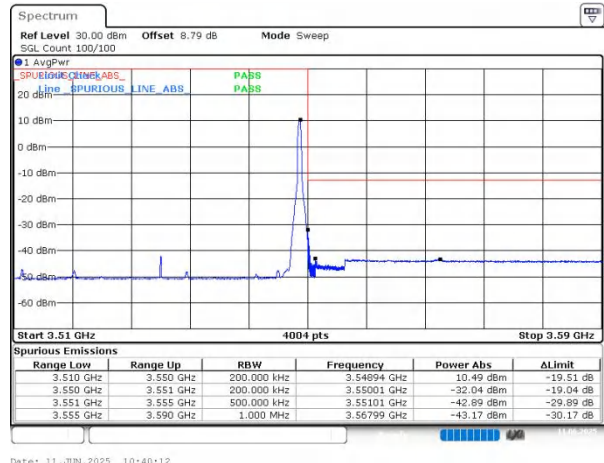


Date: 11.JUN.2025 10:40:12

n78(3450-3550) SCS=30kHz DFT_16QAM BW=40MHz
HighChannel=635332 RB=1@105

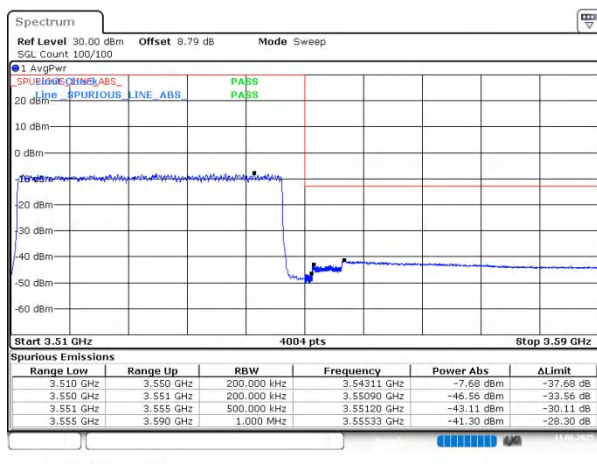


Date: 11.JUN.2025 10:40:38

n78(3450-3550) SCS=30kHz DFT_16QAM BW=40MHz
HighChannel=635332 RB=100@0

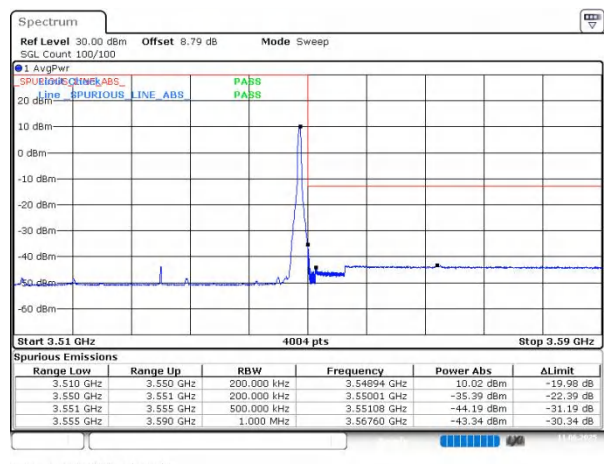


Date: 11.JUN.2025 10:41:05


n78(3450-3550) SCS=30kHz DFT_64QAM BW=40MHz
HighChannel=635332 RB=1@105

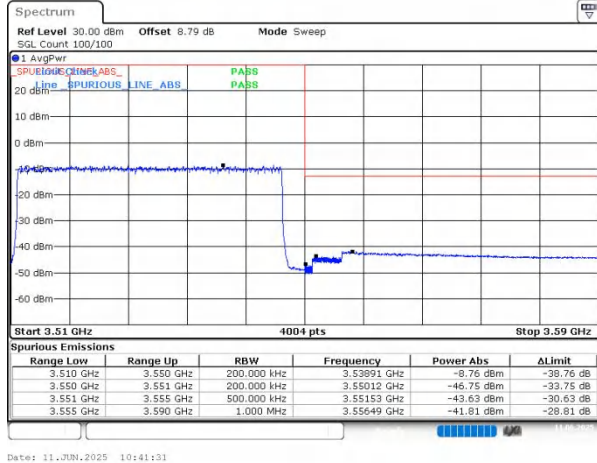


n78(3450-3550) SCS=30kHz DFT_64QAM BW=40MHz
HighChannel=635332 RB=100@0

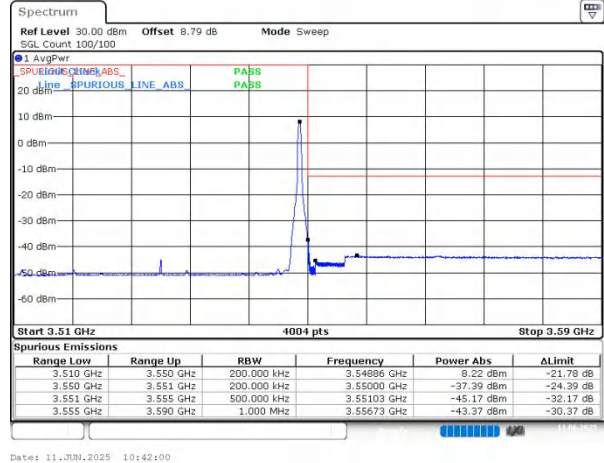


n78(3450-3550) SCS=30kHz DFT_256QAM BW=40MHz
HighChannel=635332 RB=1@105

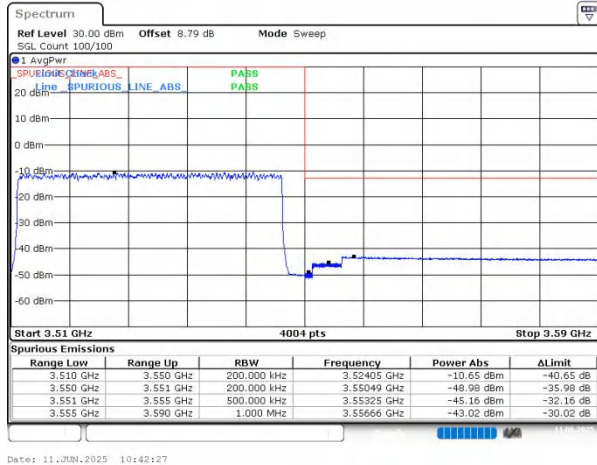


n78(3450-3550) SCS=30kHz DFT_256QAM BW=40MHz
HighChannel=635332 RB=100@0

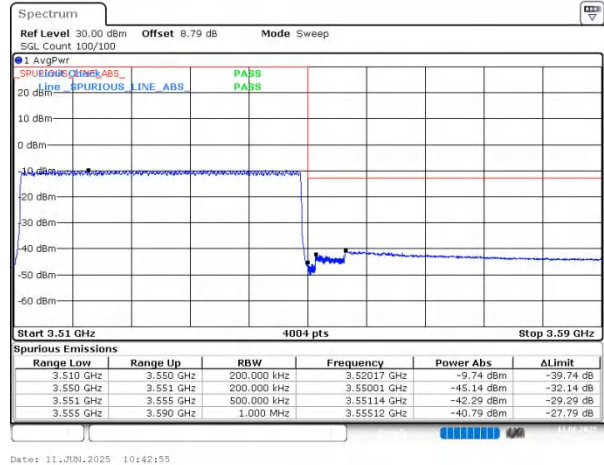


n78(3450-3550) SCS=30kHz CP_QPSK BW=40MHz
HighChannel=635332 RB=106@0

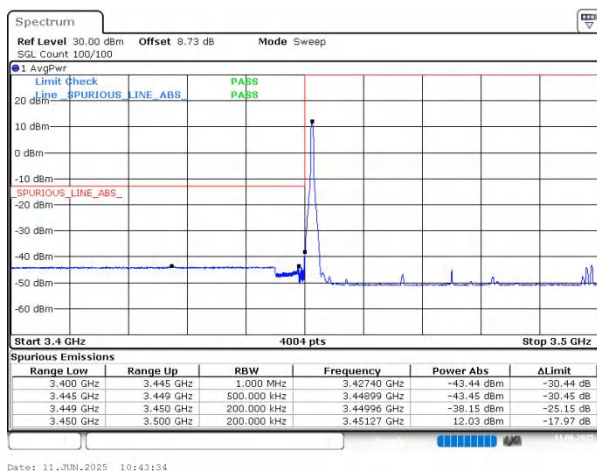


n78(3450-3550) SCS=30kHz DFT_BPSK BW=50MHz
LowChannel=631668 RB=1@0

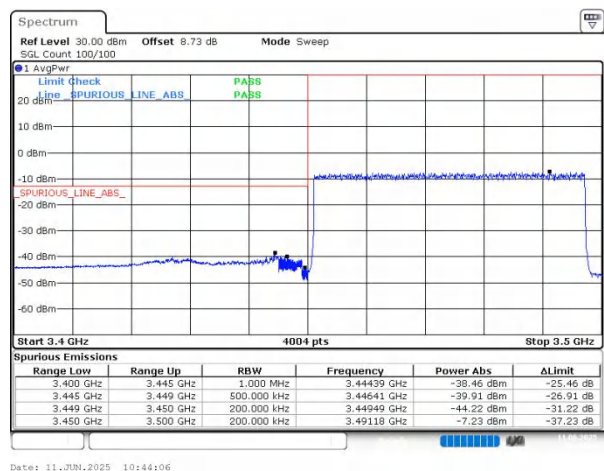


n78(3450-3550) SCS=30kHz DFT_BPSK BW=50MHz
LowChannel=631668 RB=128@0

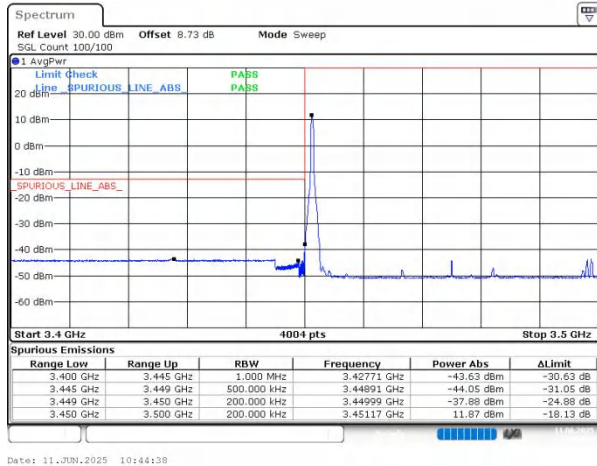


n78(3450-3550) SCS=30kHz DFT_QPSK BW=50MHz
LowChannel=631668 RB=1@0

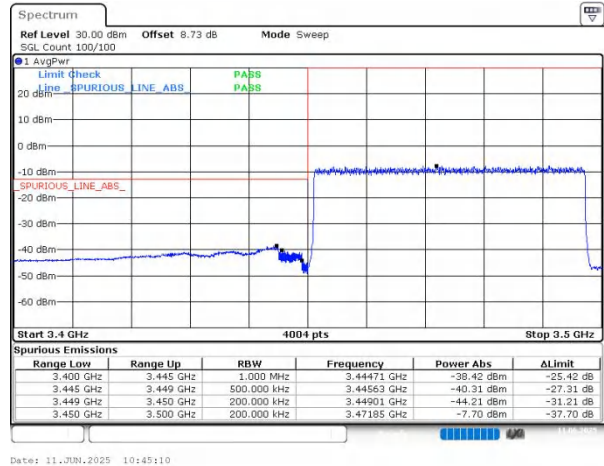


n78(3450-3550) SCS=30kHz DFT_QPSK BW=50MHz
LowChannel=631668 RB=128@0

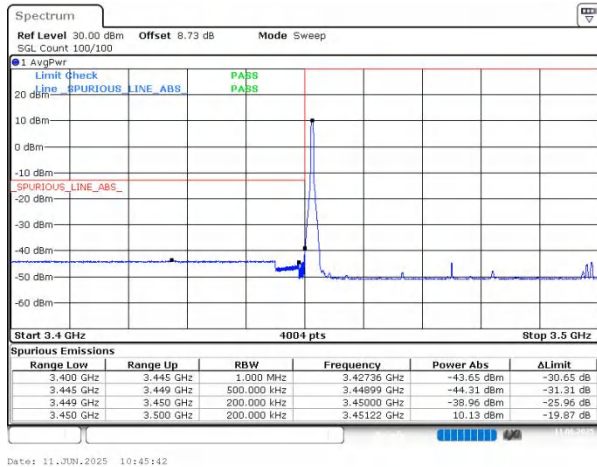


n78(3450-3550) SCS=30kHz DFT_16QAM BW=50MHz
LowChannel=631668 RB=1@0

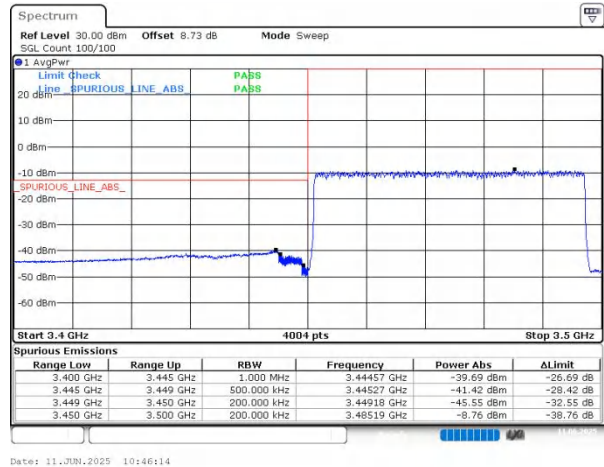


n78(3450-3550) SCS=30kHz DFT_16QAM BW=50MHz
LowChannel=631668 RB=128@0

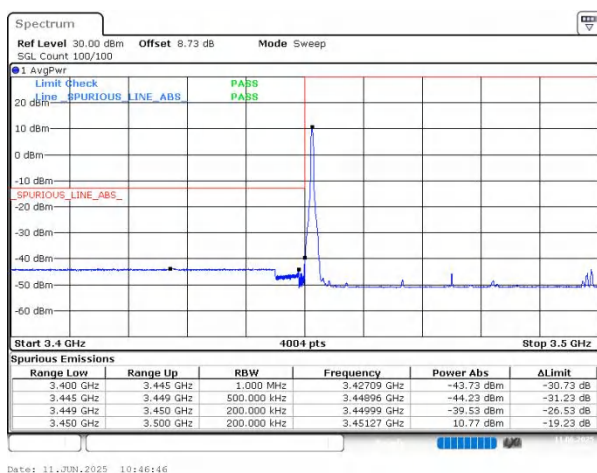

n78(3450-3550) SCS=30kHz DFT_64QAM BW=50MHz
LowChannel=631668 RB=1@0

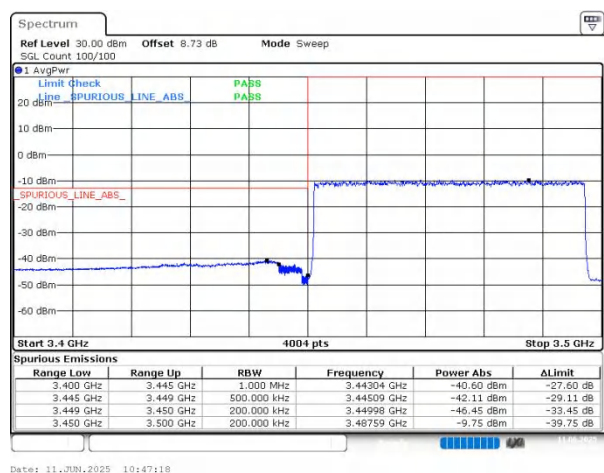


n78(3450-3550) SCS=30kHz DFT_64QAM BW=50MHz
LowChannel=631668 RB=128@0

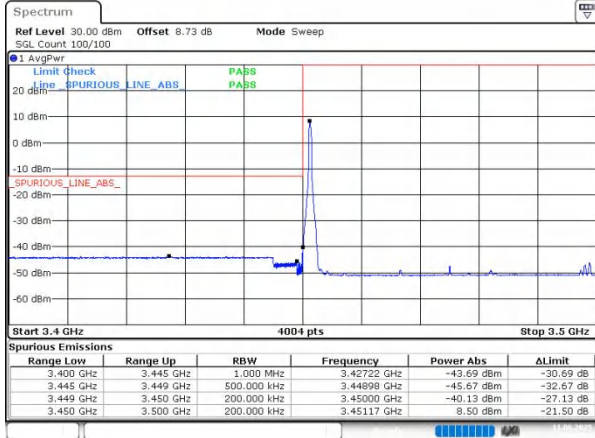


Date: 11.JUN.2025 10:47:53

n78(3450-3550) SCS=30kHz DFT_256QAM BW=50MHz
LowChannel=631668 RB=1@0

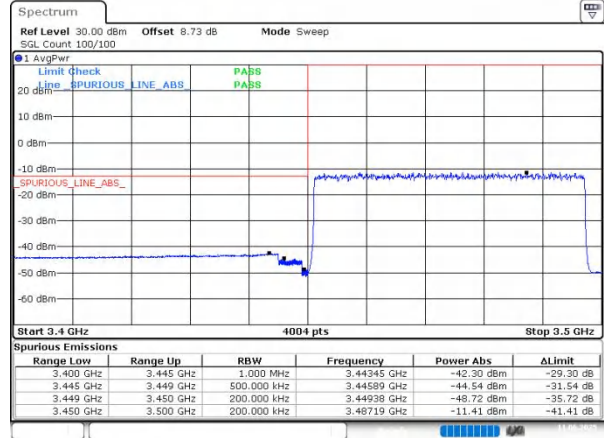


Date: 11.JUN.2025 10:48:25

n78(3450-3550) SCS=30kHz DFT_256QAM BW=50MHz
LowChannel=631668 RB=128@0

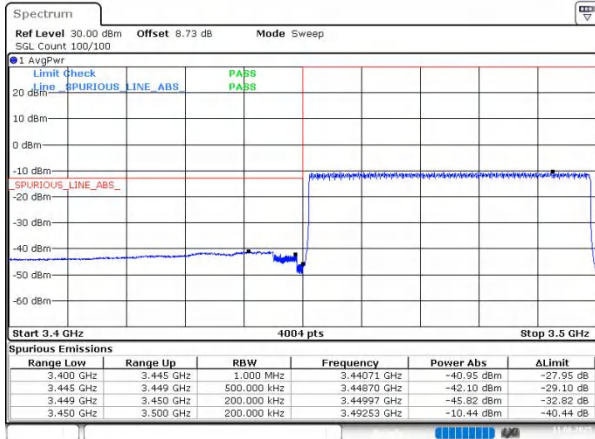


Date: 11.JUN.2025 10:49:00

n78(3450-3550) SCS=30kHz CP_QPSK BW=50MHz
LowChannel=631668 RB=133@0

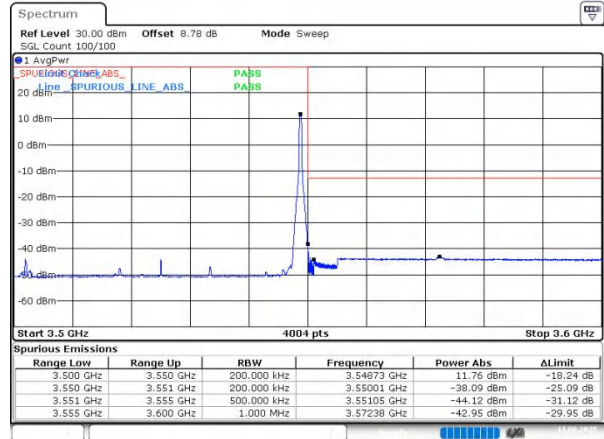


Date: 11.JUN.2025 10:49:55

n78(3450-3550) SCS=30kHz DFT_BPSK BW=50MHz
HighChannel=635000 RB=1@132

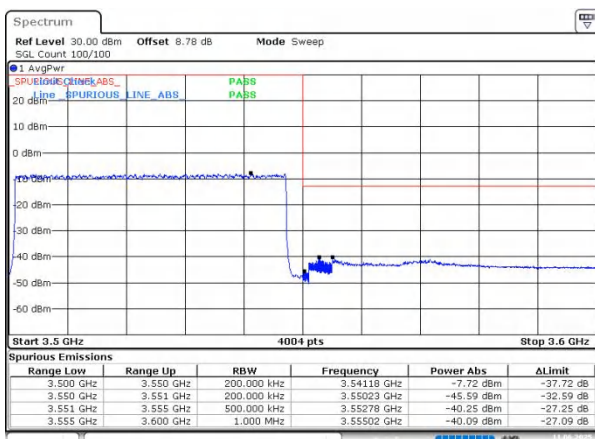


Date: 11.JUN.2025 10:50:27

n78(3450-3550) SCS=30kHz DFT_BPSK BW=50MHz
HighChannel=635000 RB=128@0

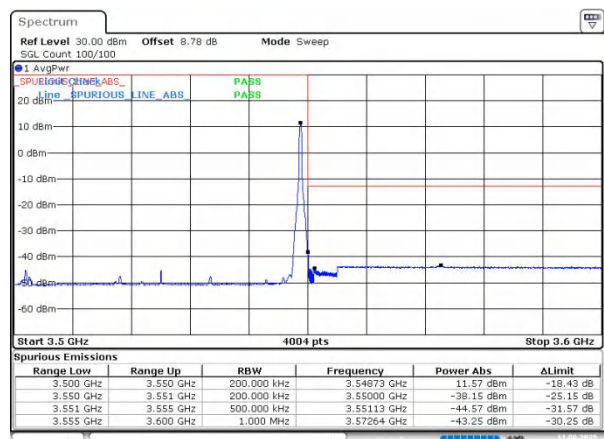


Date: 11.JUN.2025 10:50:59


n78(3450-3550) SCS=30kHz DFT_QPSK BW=50MHz
HighChannel=635000 RB=1@132

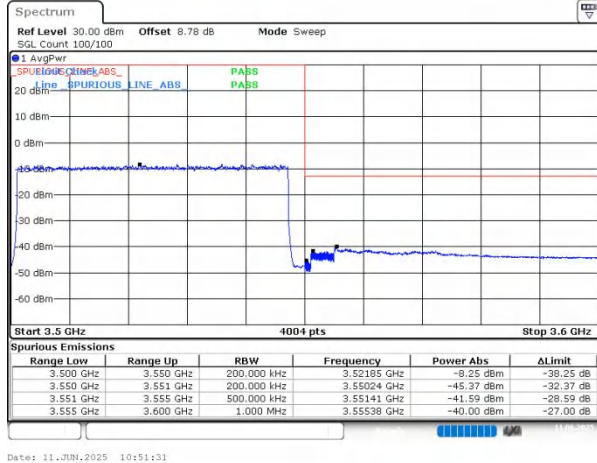


n78(3450-3550) SCS=30kHz DFT_QPSK BW=50MHz
HighChannel=635000 RB=128@0

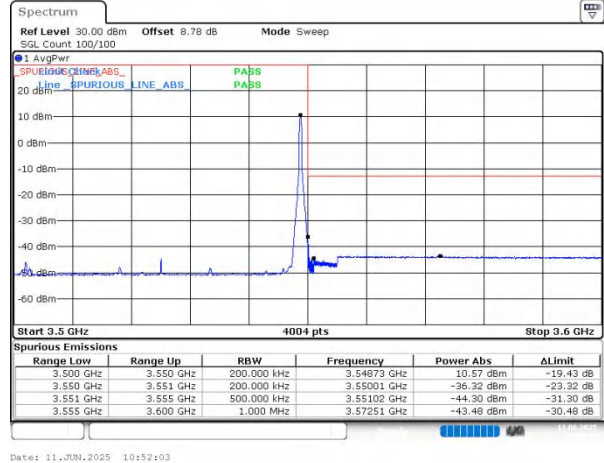


n78(3450-3550) SCS=30kHz DFT_16QAM BW=50MHz
HighChannel=635000 RB=1@132

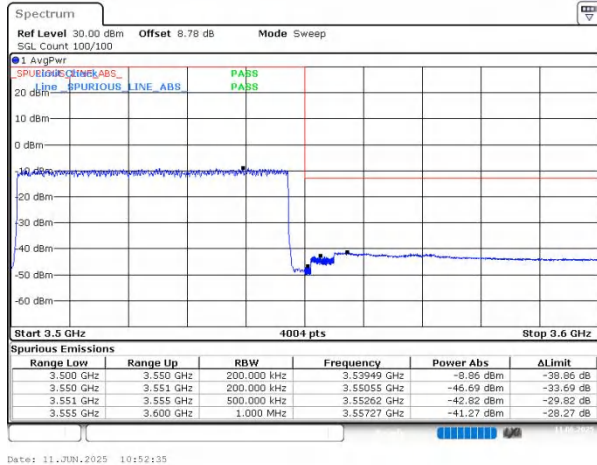


n78(3450-3550) SCS=30kHz DFT_16QAM BW=50MHz
HighChannel=635000 RB=128@0

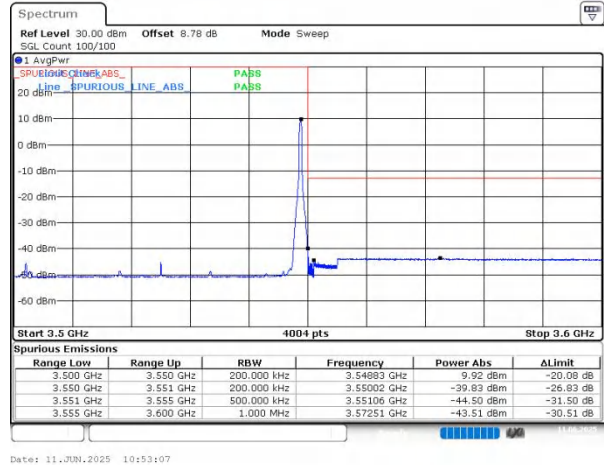

n78(3450-3550) SCS=30kHz DFT_64QAM BW=50MHz
HighChannel=635000 RB=1@132

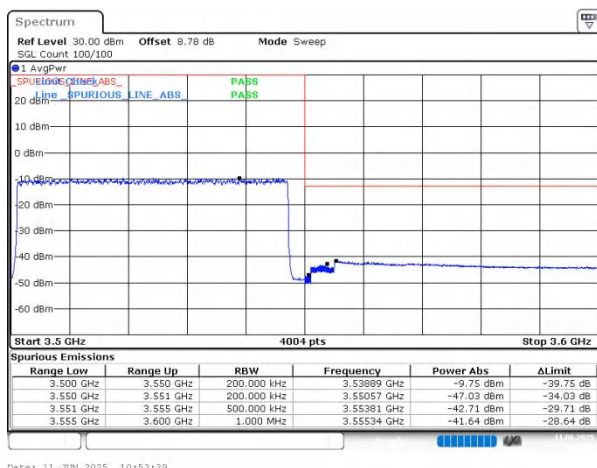

n78(3450-3550) SCS=30kHz DFT_64QAM BW=50MHz
HighChannel=635000 RB=128@0

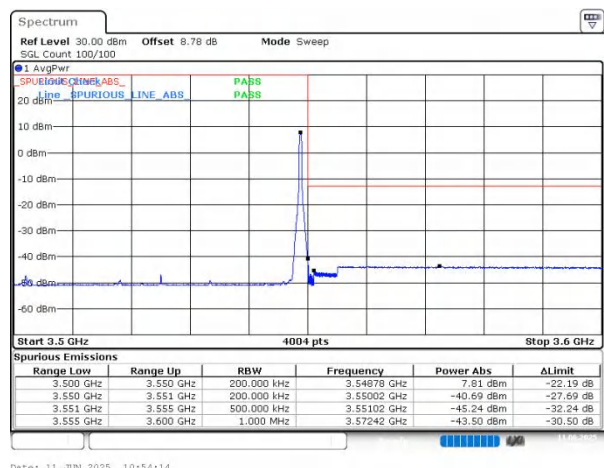

n78(3450-3550) SCS=30kHz DFT_256QAM BW=50MHz
HighChannel=635000 RB=1@132