




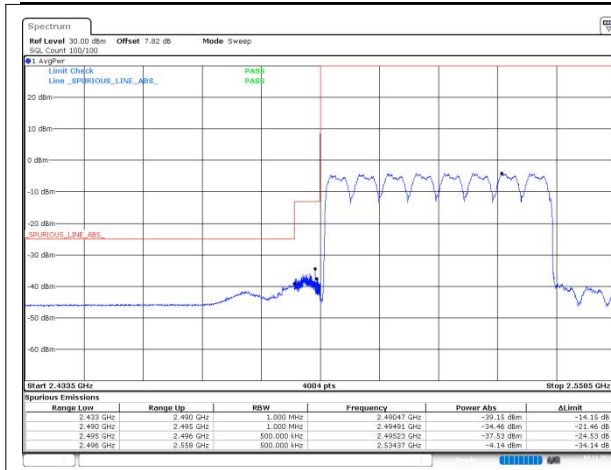


n41 SCS=30kHz CP_QPSK BW=50MHz
LowChannel=504204 RB=133@0

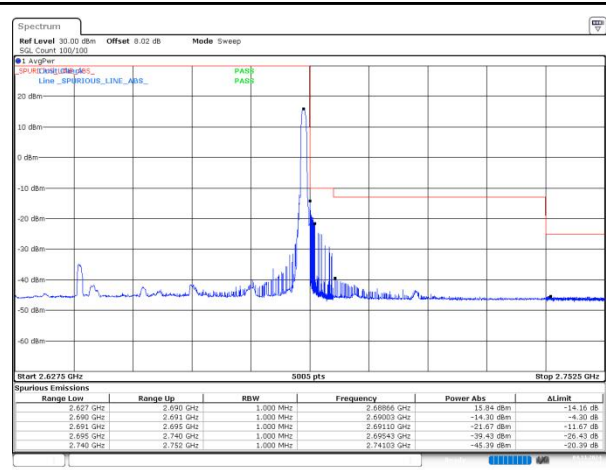


n41 SCS=30kHz DFT_BPSK BW=50MHz HighChannel=532998
RB=1@132

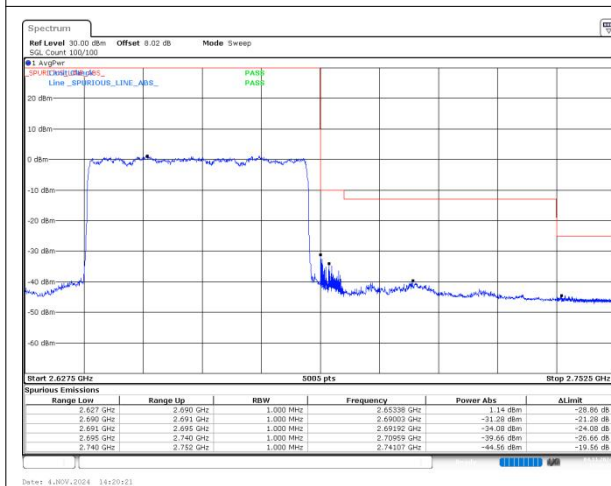


n41 SCS=30kHz DFT_BPSK BW=50MHz
HighChannel=532998 RB=128@0

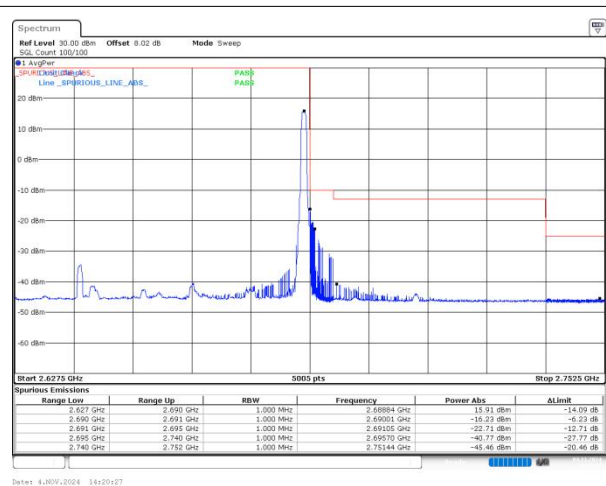


n41 SCS=30kHz DFT_QPSK BW=50MHz HighChannel=532998
RB=1@132

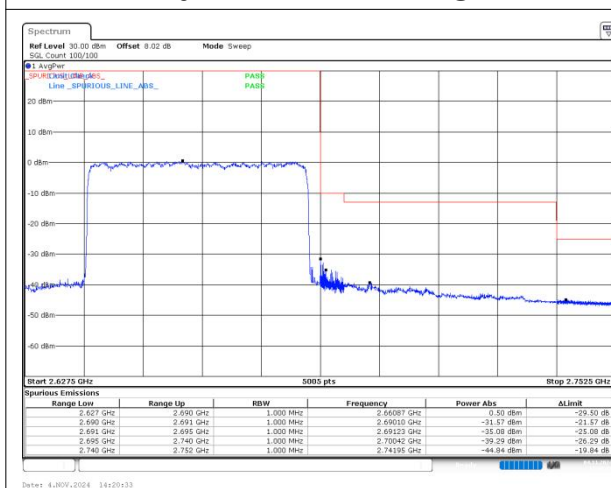


n41 SCS=30kHz DFT_QPSK BW=50MHz
HighChannel=532998 RB=128@0

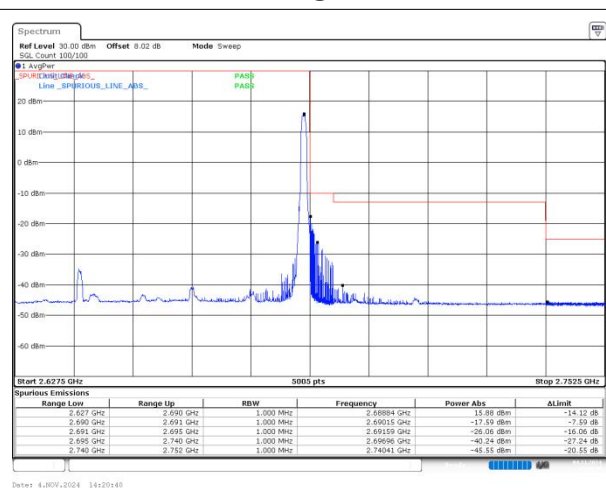


n41 SCS=30kHz DFT_16QAM BW=50MHz HighChannel=532998
RB=1@132

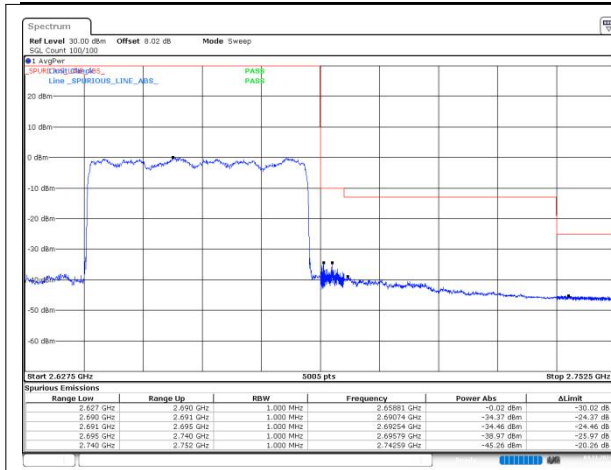


n41 SCS=30kHz DFT_16QAM BW=50MHz
HighChannel=532998 RB=128@0

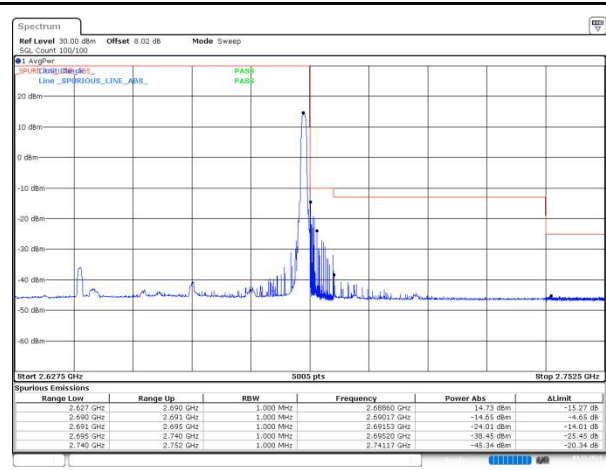


n41 SCS=30kHz DFT_64QAM BW=50MHz HighChannel=532998
RB=1@132

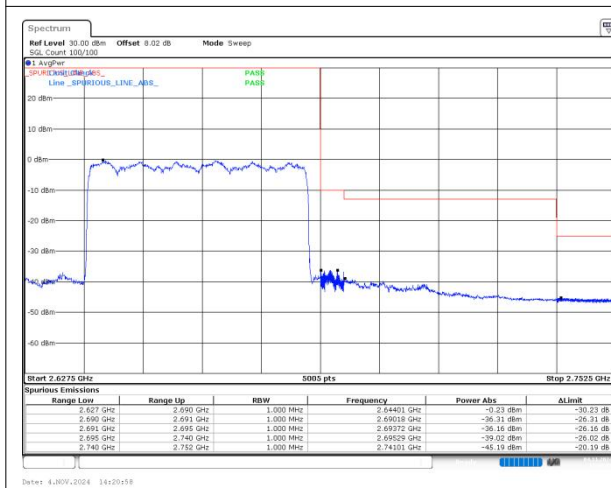


n41 SCS=30kHz DFT_64QAM BW=50MHz
HighChannel=532998 RB=128@0

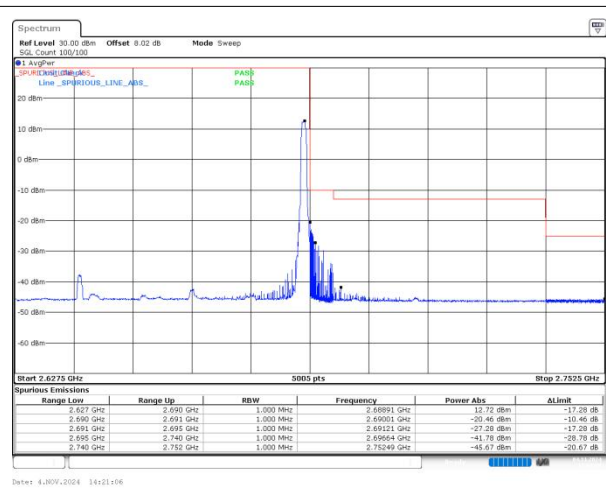


n41 SCS=30kHz DFT_256QAM BW=50MHz HighChannel=532998
RB=1@132

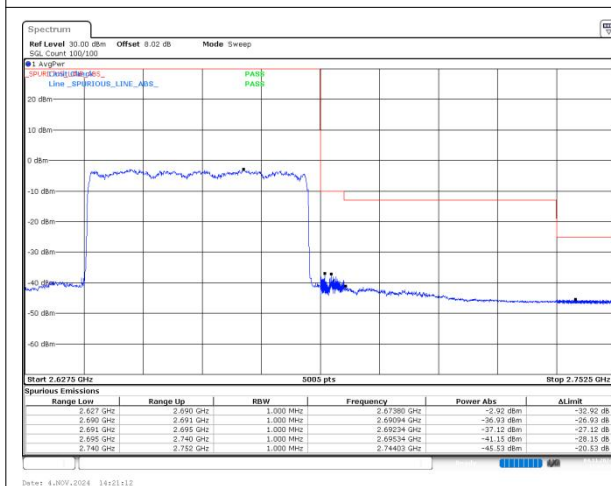


n41 SCS=30kHz DFT_256QAM BW=50MHz
HighChannel=532998 RB=128@0

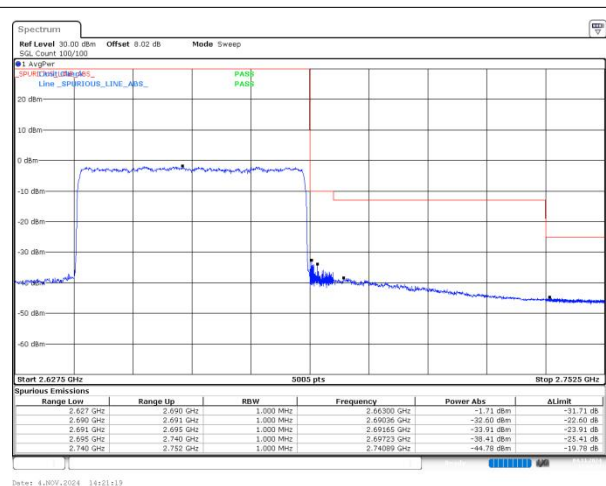


n41 SCS=30kHz CP_QPSK BW=50MHz HighChannel=532998
RB=133@0

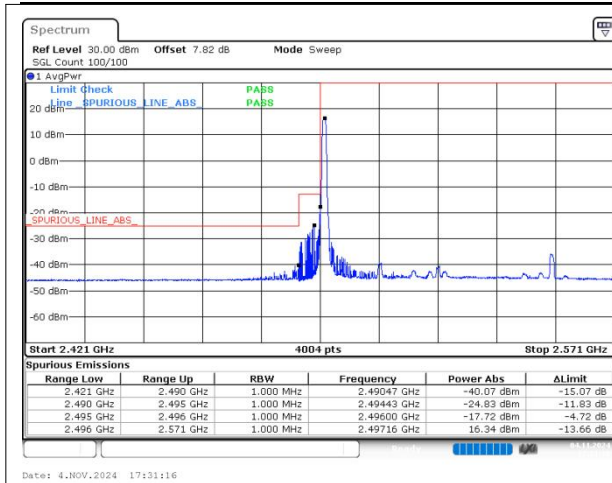


n41 SCS=30kHz DFT_BPSK BW=60MHz
LowChannel=505200 RB=1@0

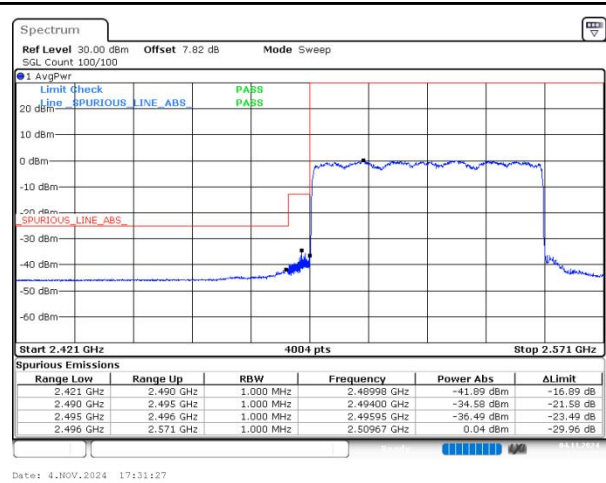


n41 SCS=30kHz DFT_BPSK BW=60MHz LowChannel=505200
RB=162@0

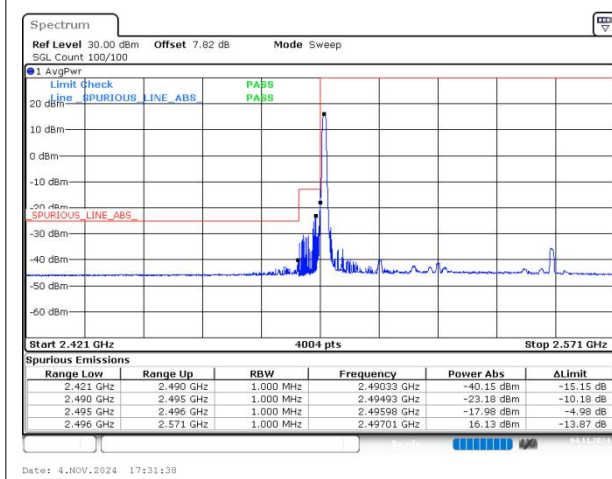


n41 SCS=30kHz DFT_QPSK BW=60MHz
LowChannel=505200 RB=1@0

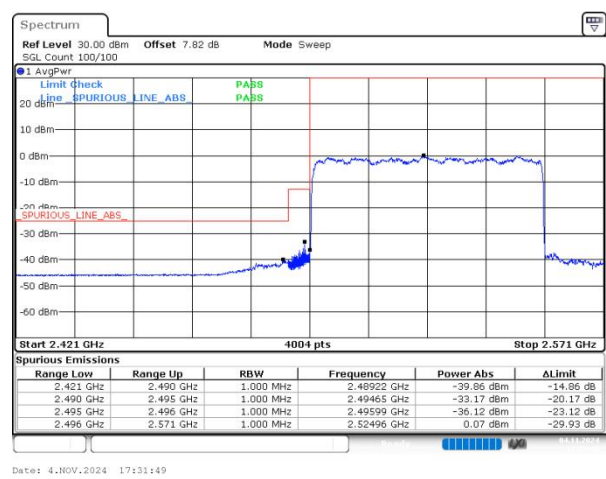


n41 SCS=30kHz DFT_QPSK BW=60MHz LowChannel=505200
RB=162@0

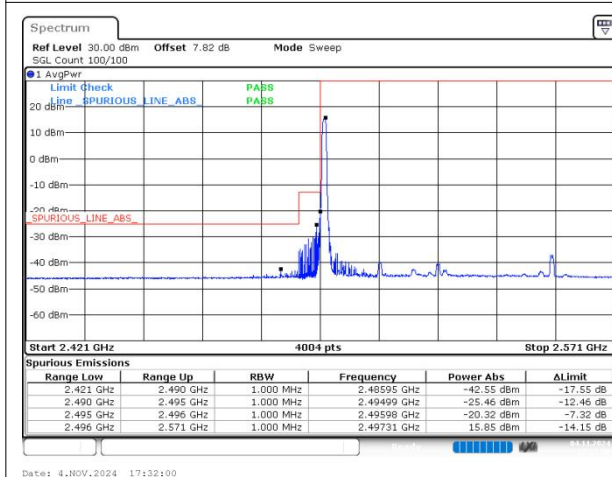

n41 SCS=30kHz DFT_16QAM BW=60MHz
LowChannel=505200 RB=1@0

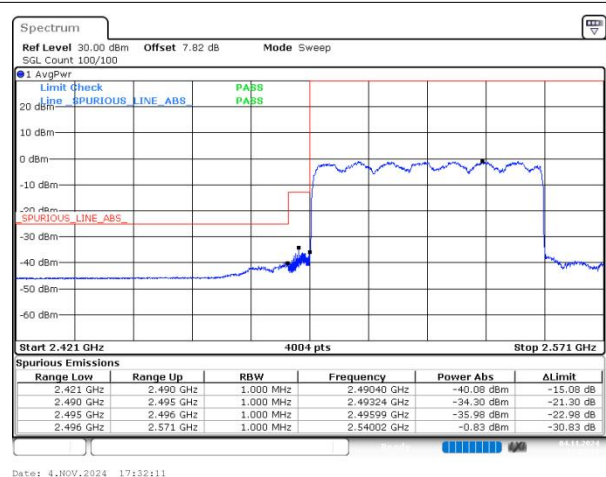


n41 SCS=30kHz DFT_16QAM BW=60MHz LowChannel=505200
RB=162@0

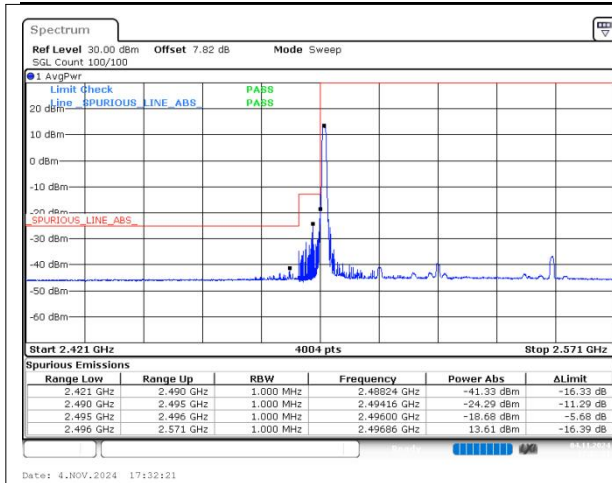


Date: 4.NOV.2024 17:32:21

n41 SCS=30kHz DFT_64QAM BW=60MHz
LowChannel=505200 RB=1@0

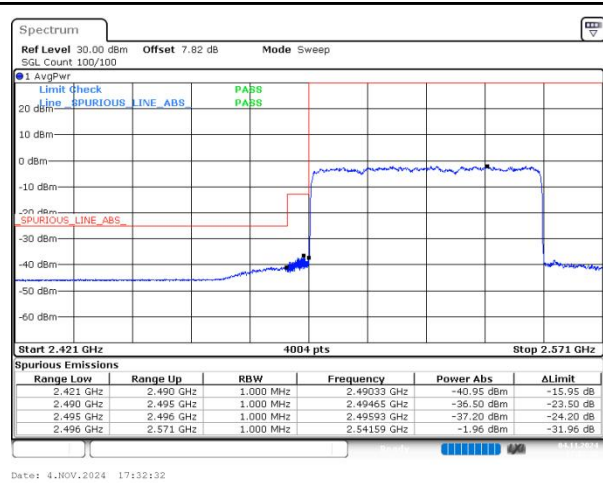


Date: 4.NOV.2024 17:32:32

n41 SCS=30kHz DFT_64QAM BW=60MHz LowChannel=505200
RB=162@0

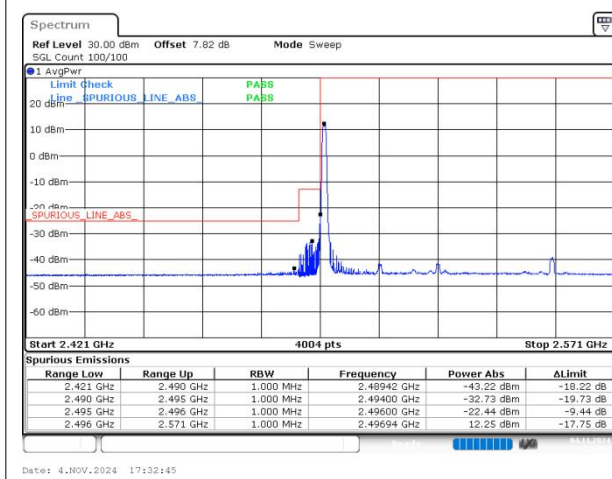


Date: 4.NOV.2024 17:32:45

n41 SCS=30kHz DFT_256QAM BW=60MHz
LowChannel=505200 RB=1@0

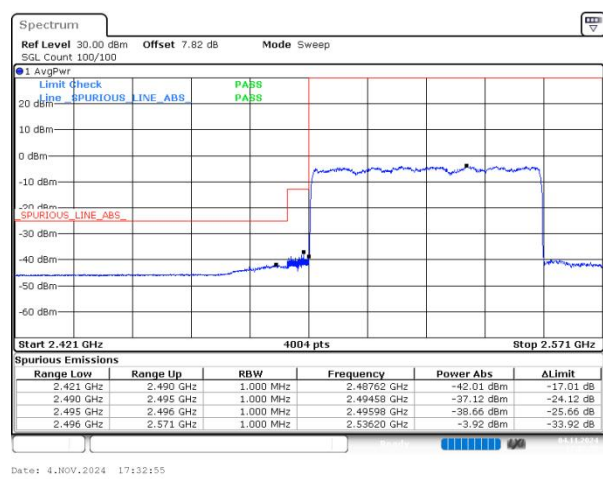


Date: 4.NOV.2024 17:32:55

n41 SCS=30kHz DFT_256QAM BW=60MHz LowChannel=505200
RB=162@0

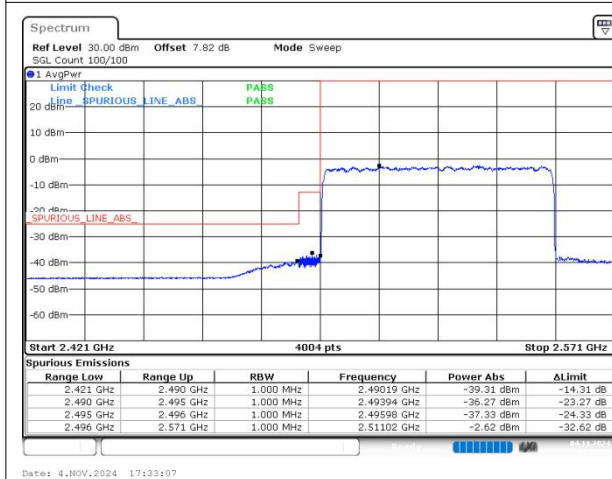


Date: 4.NOV.2024 17:33:07

n41 SCS=30kHz CP_QPSK BW=60MHz
LowChannel=505200 RB=162@0

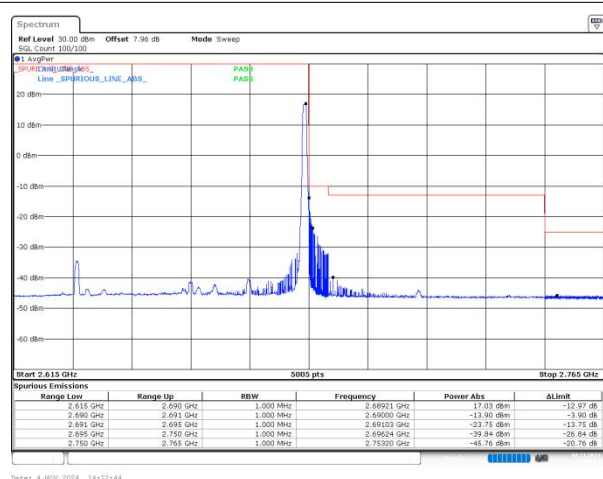


Date: 4.NOV.2024 16:02:44


n41 SCS=30kHz DFT_BPSK BW=60MHz HighChannel=531996
RB=1@161

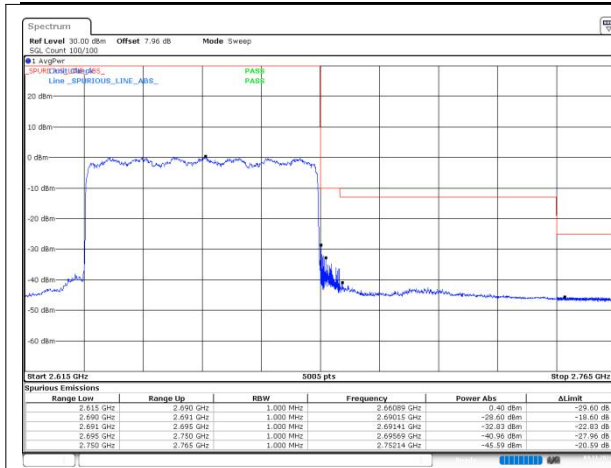


n41 SCS=30kHz DFT_BPSK BW=60MHz
HighChannel=531996 RB=162@0

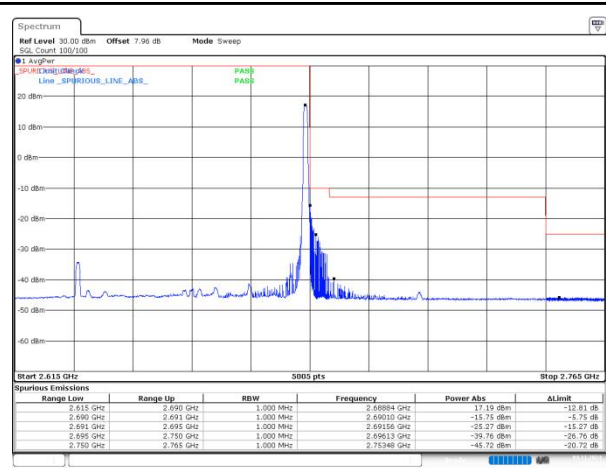


n41 SCS=30kHz DFT_QPSK BW=60MHz HighChannel=531996
RB=1@161

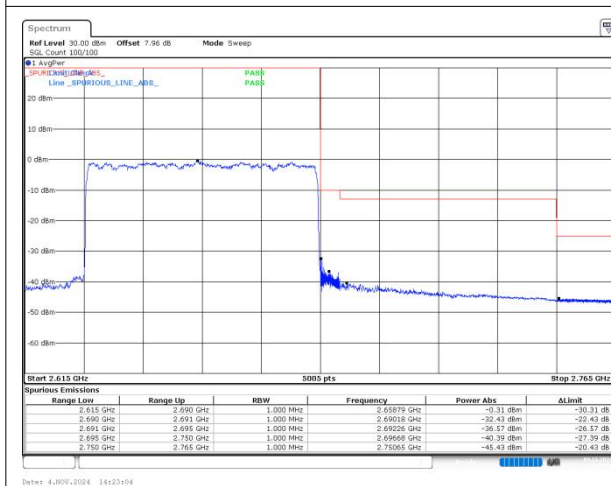


n41 SCS=30kHz DFT_QPSK BW=60MHz
HighChannel=531996 RB=162@0

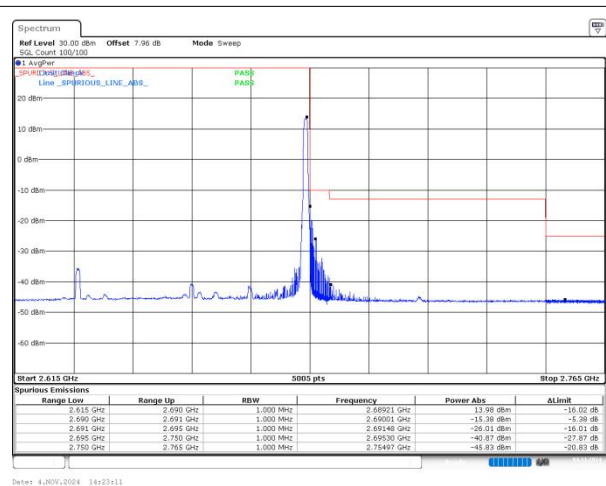


n41 SCS=30kHz DFT_16QAM BW=60MHz HighChannel=531996
RB=1@161

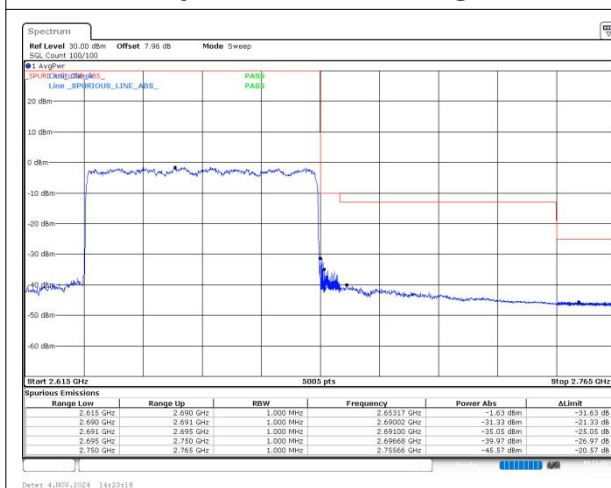


n41 SCS=30kHz DFT_16QAM BW=60MHz
HighChannel=531996 RB=162@0

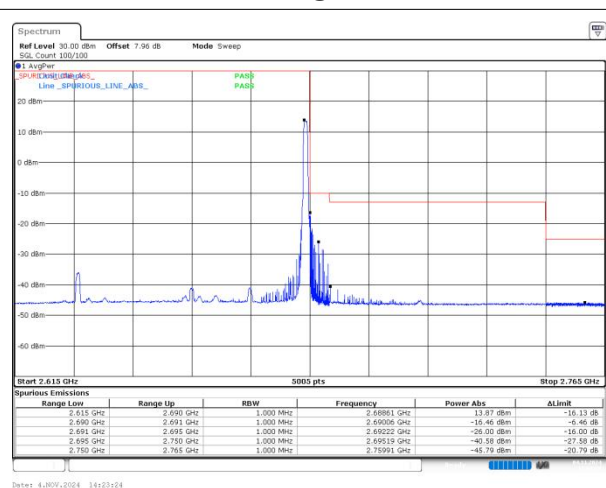


n41 SCS=30kHz DFT_64QAM BW=60MHz HighChannel=531996
RB=1@161

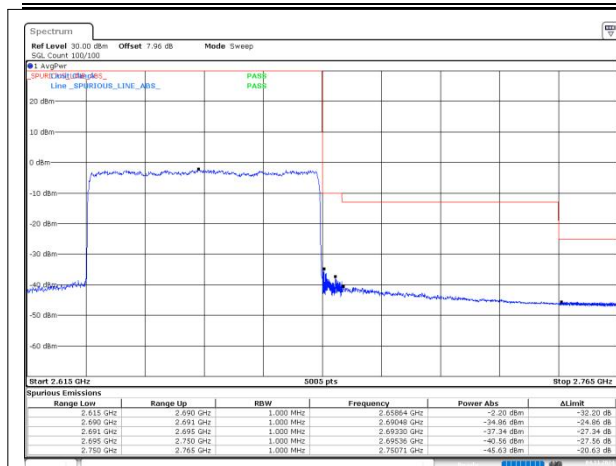


n41 SCS=30kHz DFT_64QAM BW=60MHz
HighChannel=531996 RB=162@0

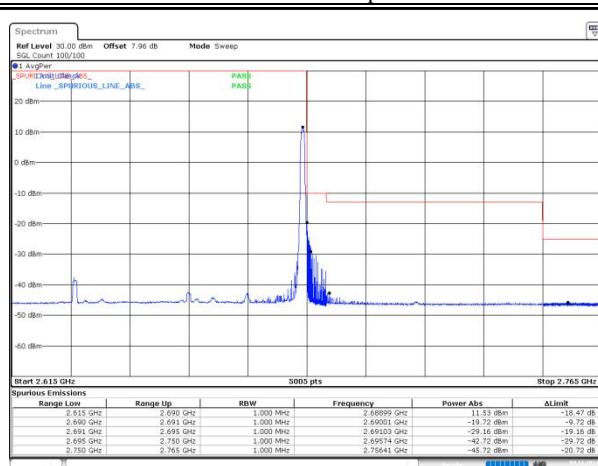


n41 SCS=30kHz DFT_256QAM BW=60MHz HighChannel=531996
RB=1@161

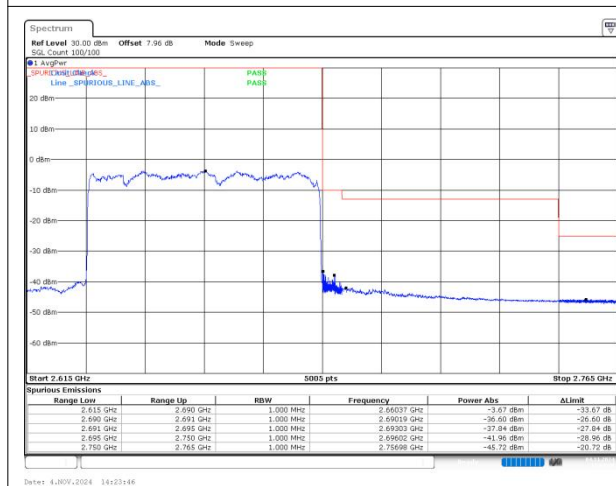


n41 SCS=30kHz DFT_256QAM BW=60MHz
HighChannel=531996 RB=162@0

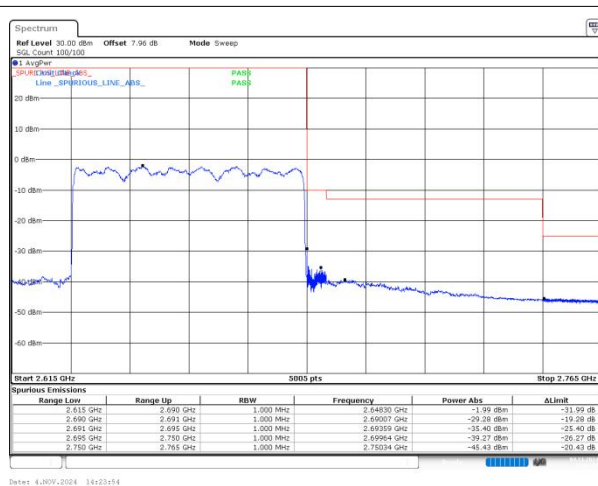


n41 SCS=30kHz CP_QPSK BW=60MHz HighChannel=531996
RB=162@0

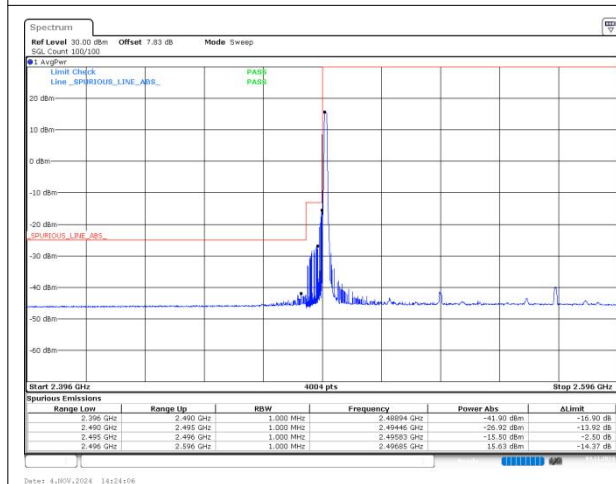


n41 SCS=30kHz DFT_BPSK BW=80MHz
LowChannel=507204 RB=1@0

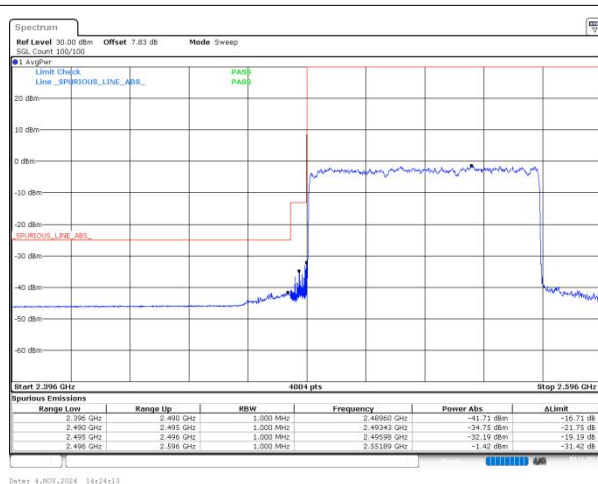


n41 SCS=30kHz DFT_BPSK BW=80MHz LowChannel=507204
RB=216@0

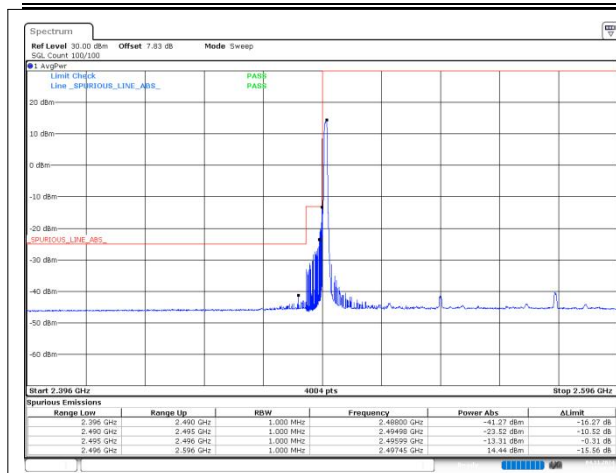


n41 SCS=30kHz DFT_QPSK BW=80MHz
LowChannel=507204 RB=1@0

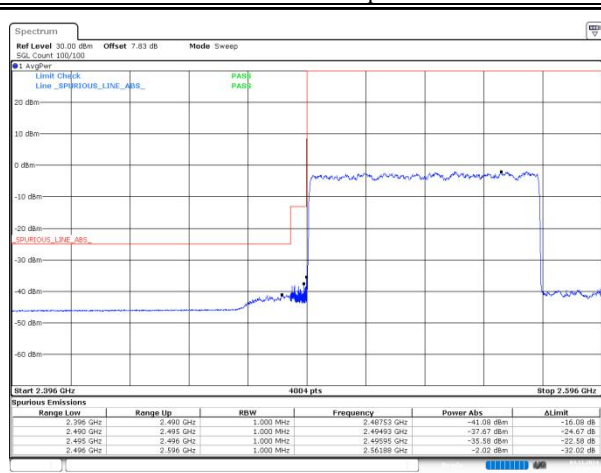


n41 SCS=30kHz DFT_QPSK BW=80MHz LowChannel=507204
RB=216@0

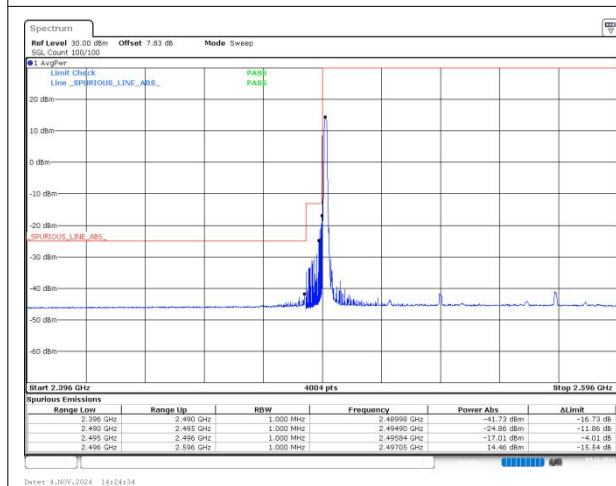


n41 SCS=30kHz DFT_16QAM BW=80MHz
LowChannel=507204 RB=1@0

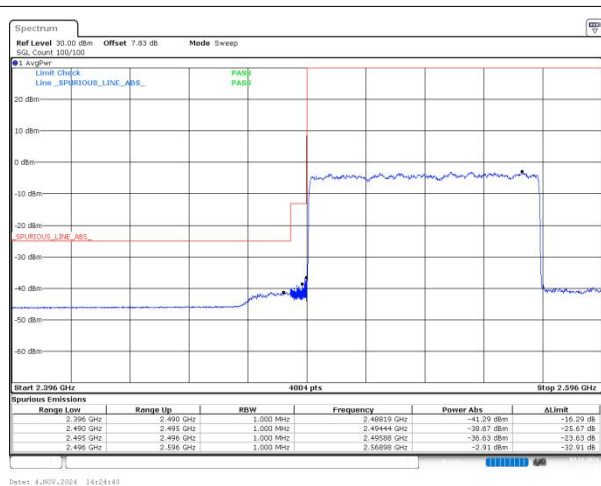


n41 SCS=30kHz DFT_16QAM BW=80MHz LowChannel=507204
RB=216@0

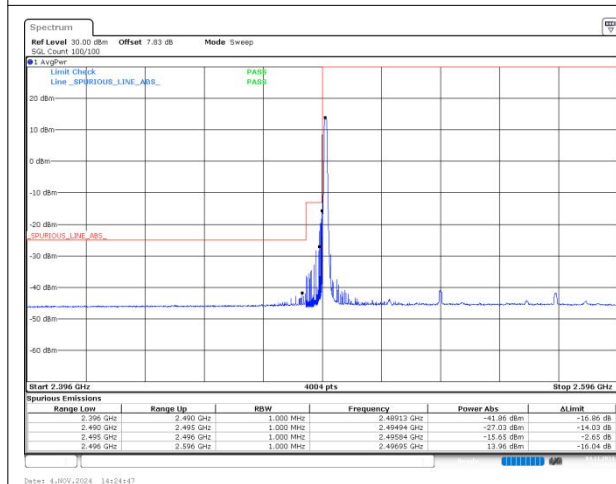

n41 SCS=30kHz DFT_64QAM BW=80MHz
LowChannel=507204 RB=1@0

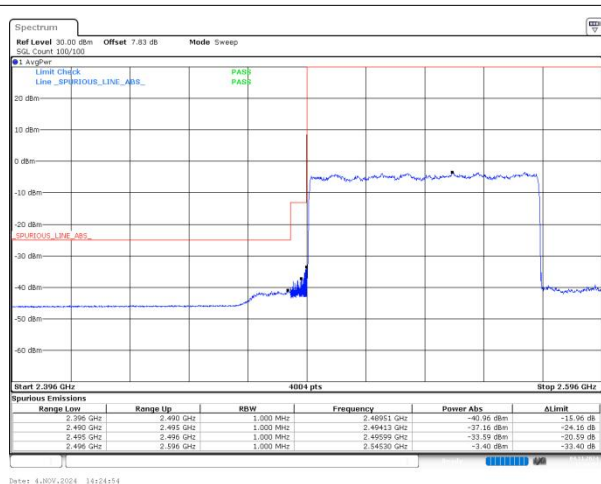


n41 SCS=30kHz DFT_64QAM BW=80MHz LowChannel=507204
RB=216@0

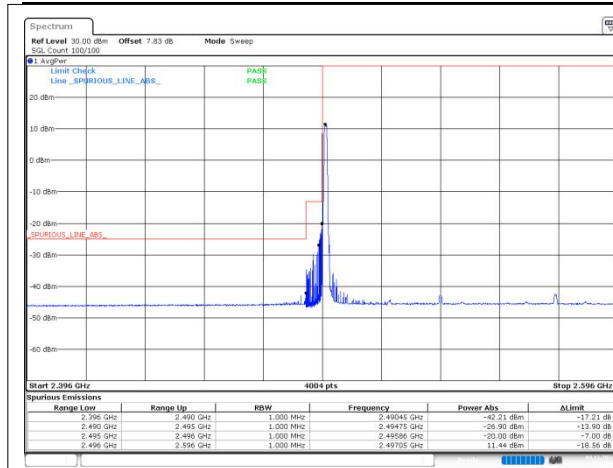


Date: 4/30/2024 14:25:03

n41 SCS=30kHz DFT_256QAM BW=80MHz
LowChannel=507204 RB=1@0

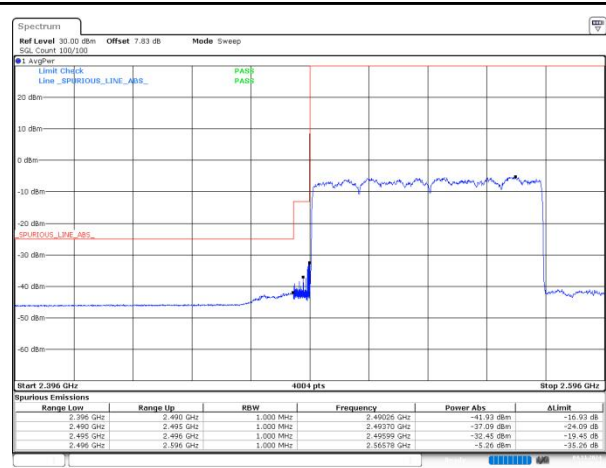


Date: 4/30/2024 14:25:09

n41 SCS=30kHz DFT_256QAM BW=80MHz LowChannel=507204
RB=216@0

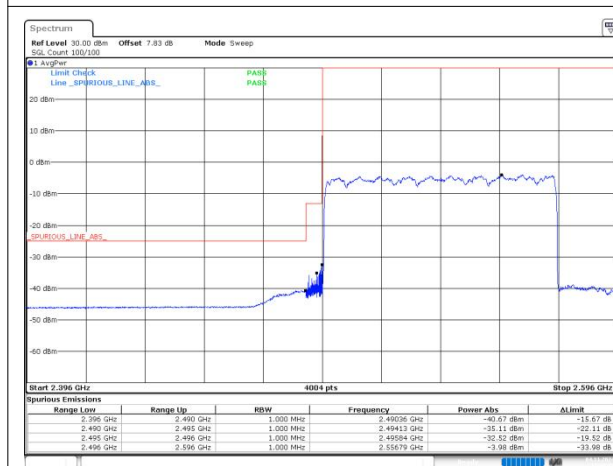


Date: 4/30/2024 14:25:17

n41 SCS=30kHz CP_QPSK BW=80MHz
LowChannel=507204 RB=217@0

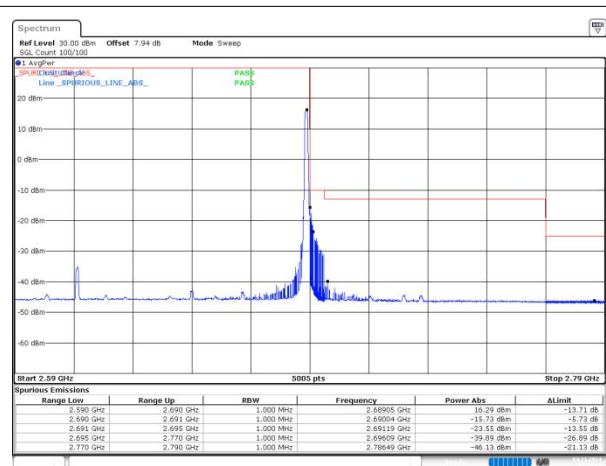


Date: 4/30/2024 14:25:31

n41 SCS=30kHz DFT_BPSK BW=80MHz HighChannel=529998
RB=1@216

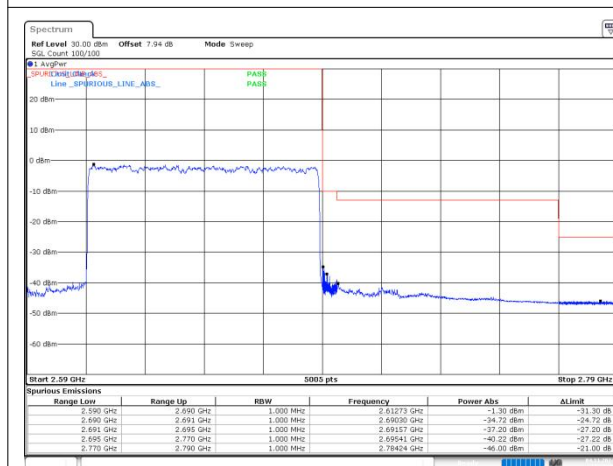


Date: 4/30/2024 14:25:38

n41 SCS=30kHz DFT_BPSK BW=80MHz
HighChannel=529998 RB=216@0

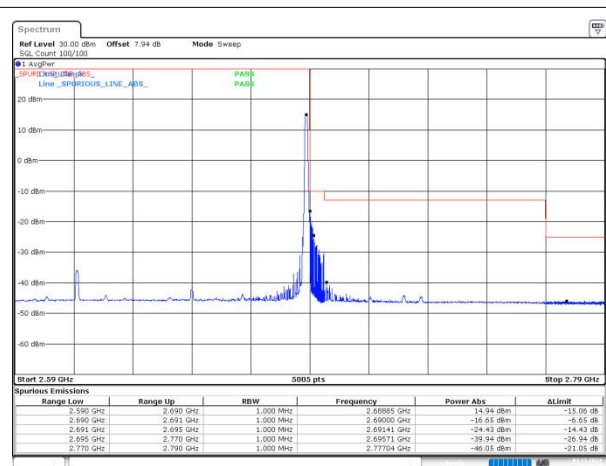


Date: 4/30/2024 14:25:46


n41 SCS=30kHz DFT_QPSK BW=80MHz HighChannel=529998
RB=1@216

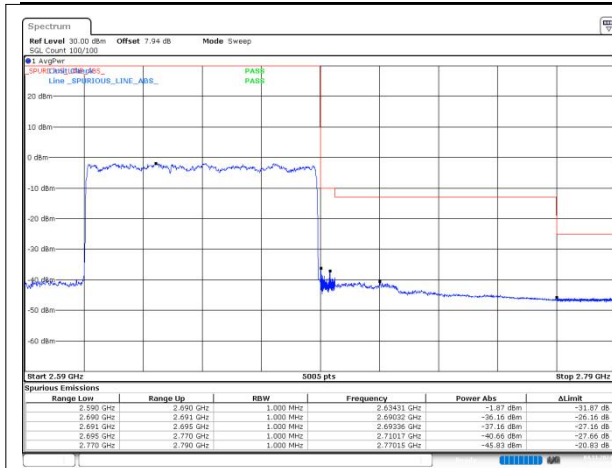


n41 SCS=30kHz DFT_QPSK BW=80MHz
HighChannel=529998 RB=216@0

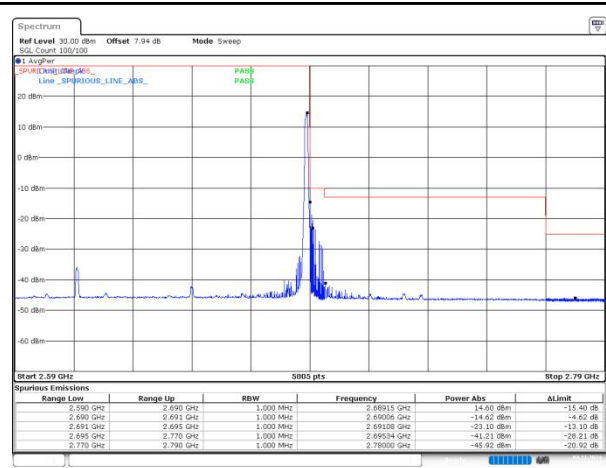


n41 SCS=30kHz DFT_16QAM BW=80MHz HighChannel=529998
RB=1@216

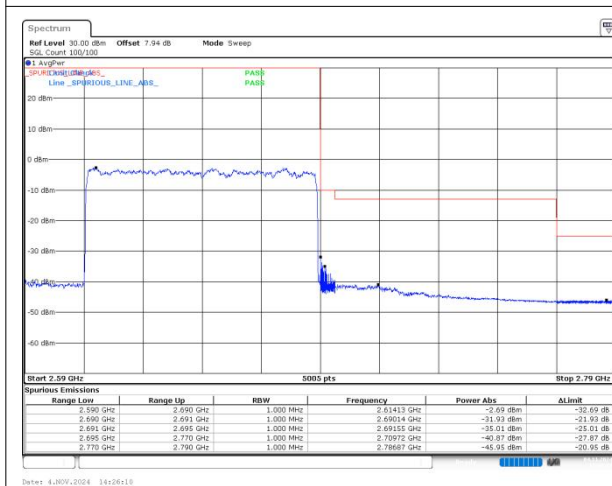


n41 SCS=30kHz DFT_16QAM BW=80MHz
HighChannel=529998 RB=216@0

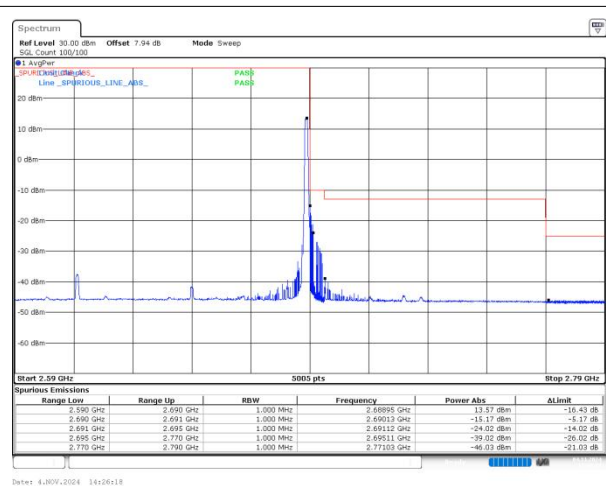


n41 SCS=30kHz DFT_64QAM BW=80MHz HighChannel=529998
RB=1@216

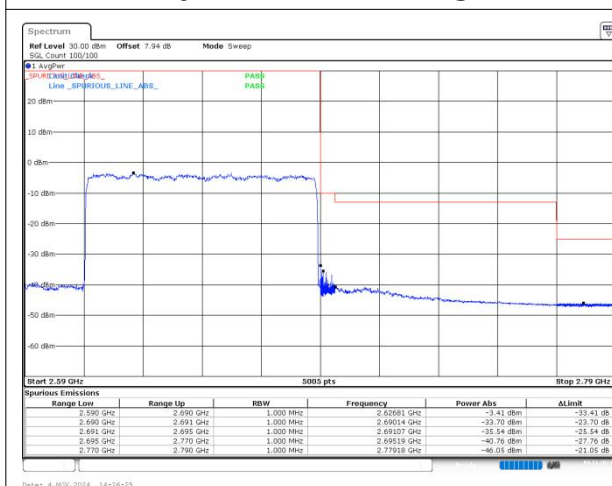


n41 SCS=30kHz DFT_64QAM BW=80MHz
HighChannel=529998 RB=216@0

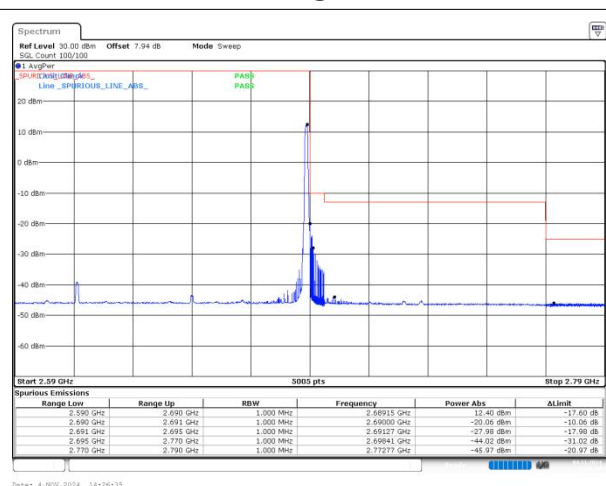


n41 SCS=30kHz DFT_256QAM BW=80MHz HighChannel=529998
RB=1@216

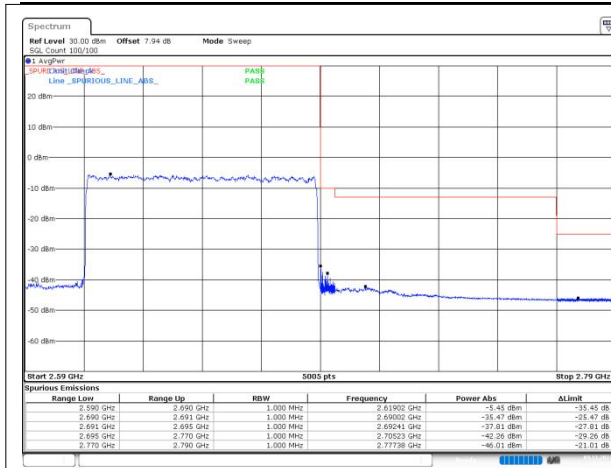


n41 SCS=30kHz DFT_256QAM BW=80MHz
HighChannel=529998 RB=216@0

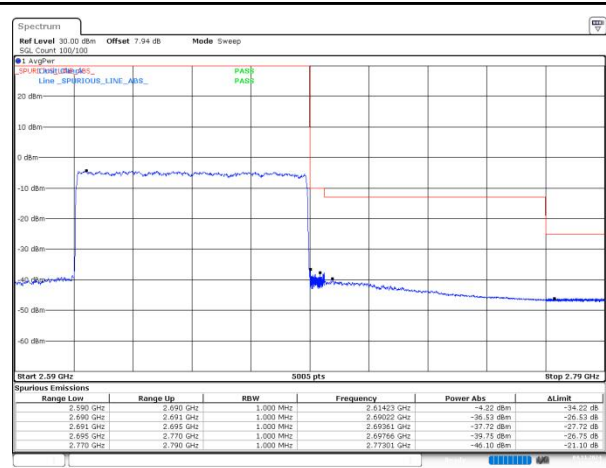


n41 SCS=30kHz CP_QPSK BW=80MHz HighChannel=529998
RB=217@0

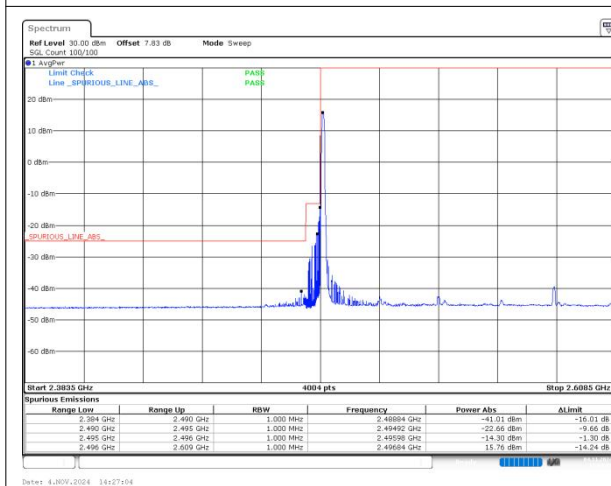


n41 SCS=30kHz DFT_BPSK BW=90MHz
LowChannel=508200 RB=1@0

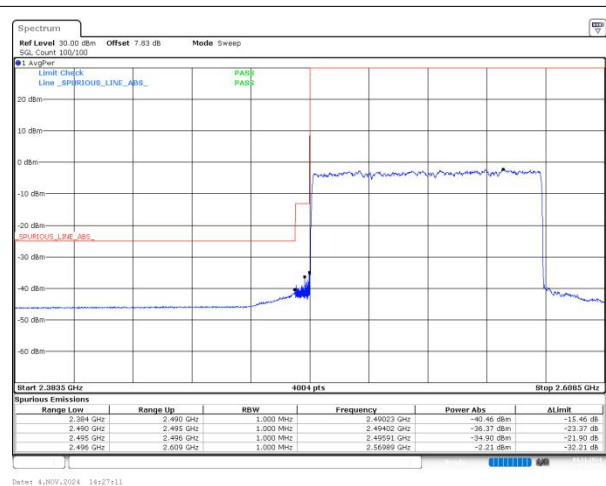


n41 SCS=30kHz DFT_BPSK BW=90MHz LowChannel=508200
RB=243@0

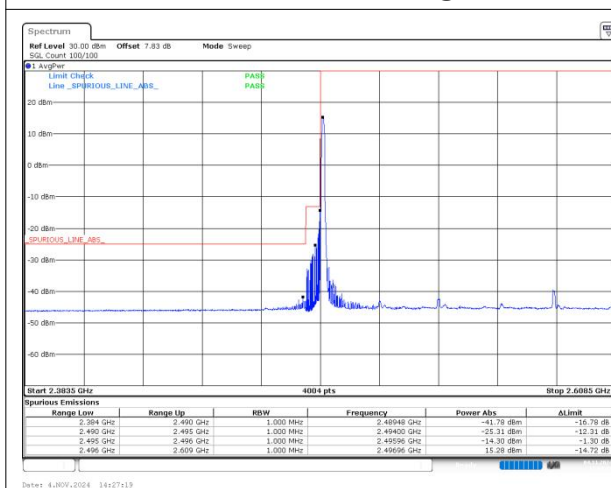


n41 SCS=30kHz DFT_QPSK BW=90MHz
LowChannel=508200 RB=1@0

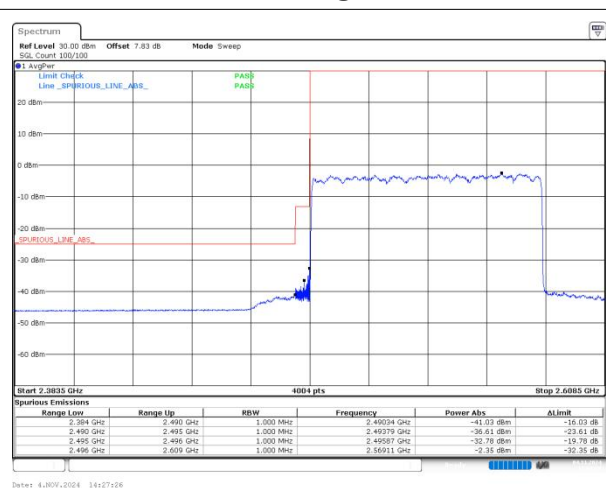


n41 SCS=30kHz DFT_QPSK BW=90MHz LowChannel=508200
RB=243@0

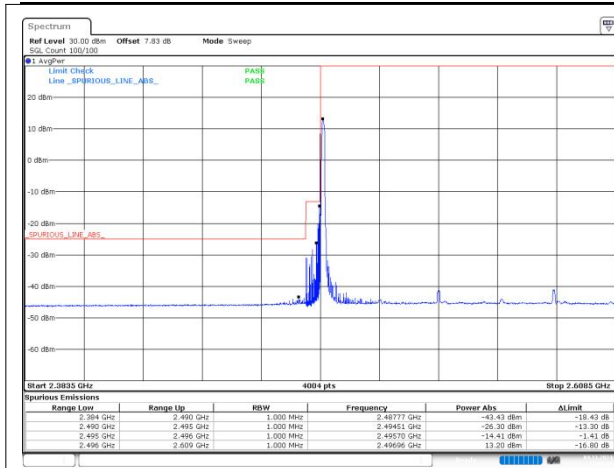


n41 SCS=30kHz DFT_16QAM BW=90MHz
LowChannel=508200 RB=1@0

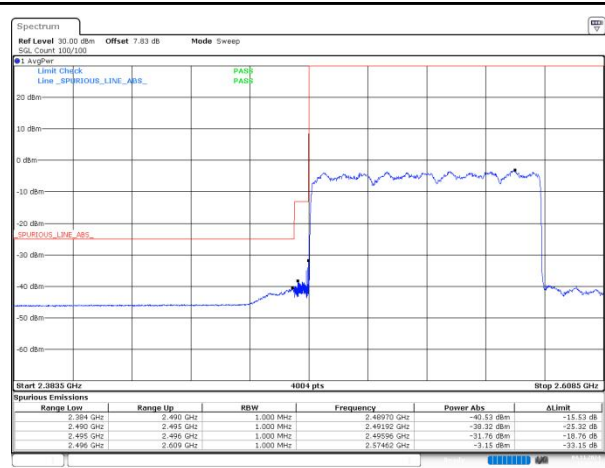


n41 SCS=30kHz DFT_16QAM BW=90MHz LowChannel=508200
RB=243@0

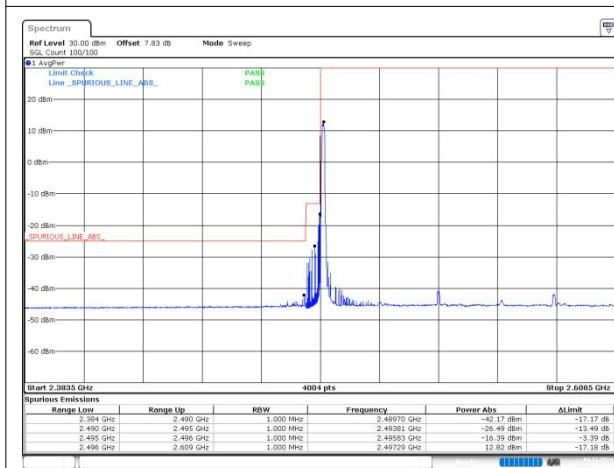


n41 SCS=30kHz DFT_64QAM BW=90MHz
LowChannel=508200 RB=1@0

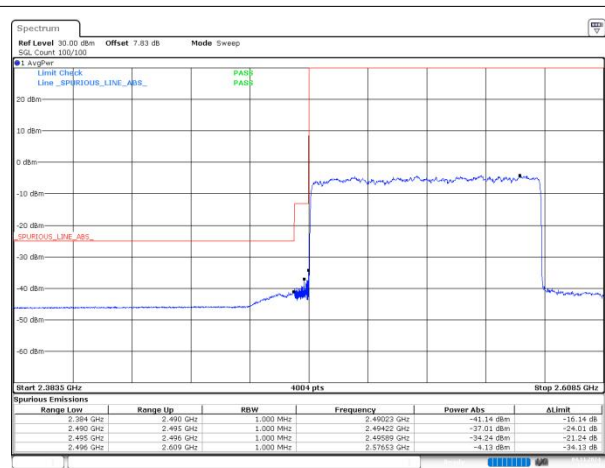


n41 SCS=30kHz DFT_64QAM BW=90MHz LowChannel=508200
RB=243@0

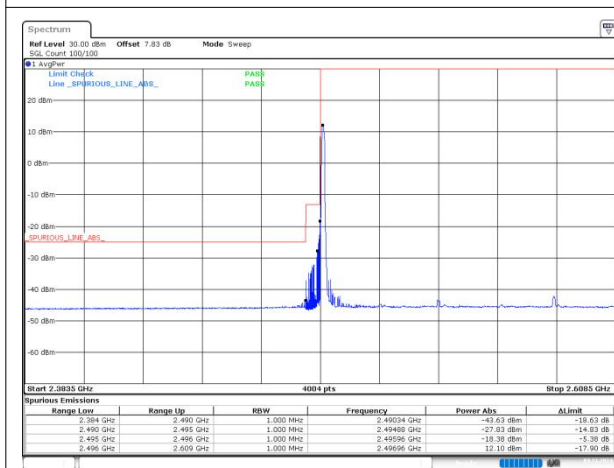


n41 SCS=30kHz DFT_256QAM BW=90MHz
LowChannel=508200 RB=1@0

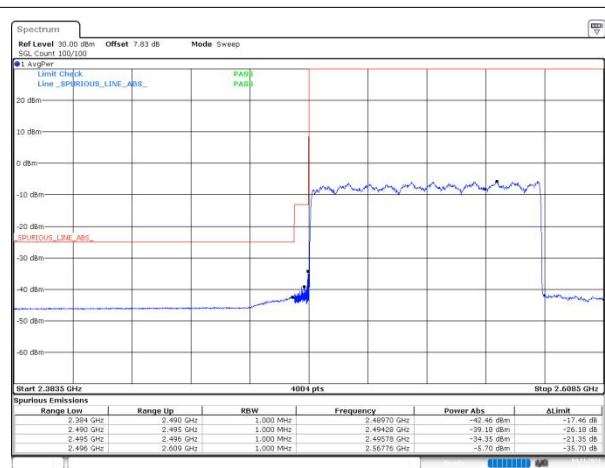


n41 SCS=30kHz DFT_256QAM BW=90MHz LowChannel=508200
RB=243@0

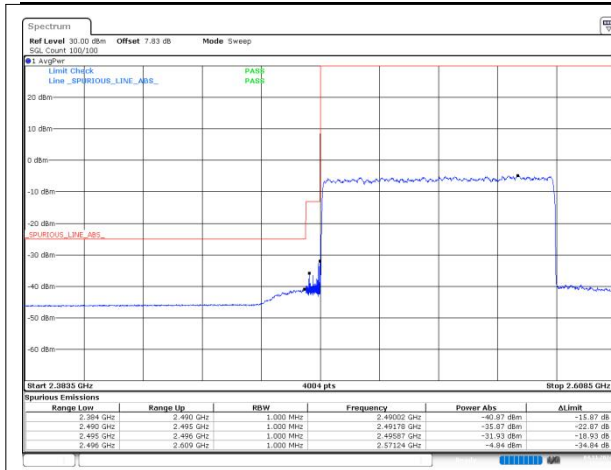


n41 SCS=30kHz CP_QPSK BW=90MHz
LowChannel=508200 RB=245@0

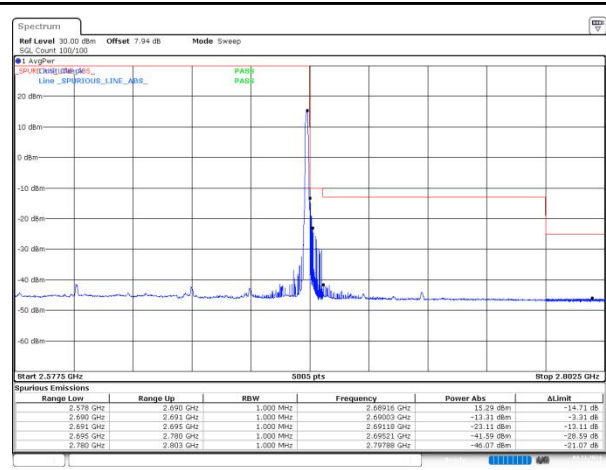


n41 SCS=30kHz DFT_BPSK BW=90MHz HighChannel=528996
RB=1@244

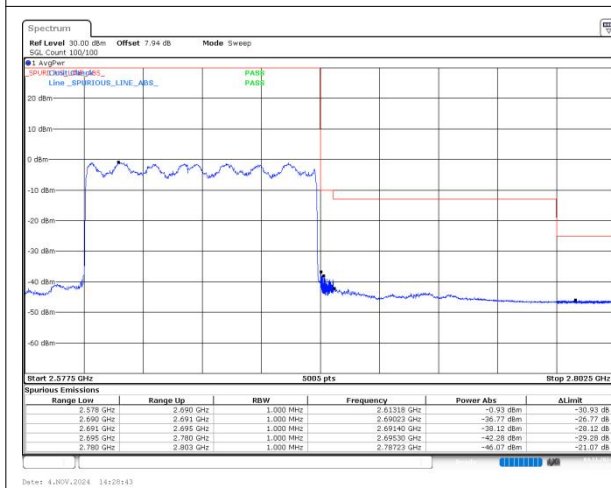


n41 SCS=30kHz DFT_BPSK BW=90MHz
HighChannel=528996 RB=243@0

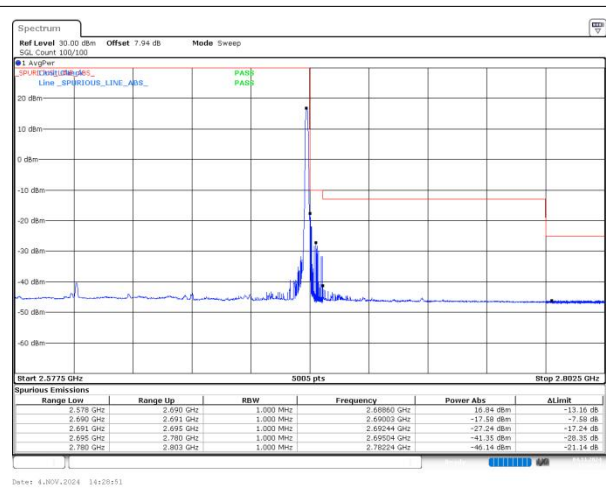


n41 SCS=30kHz DFT_QPSK BW=90MHz HighChannel=528996
RB=1@244

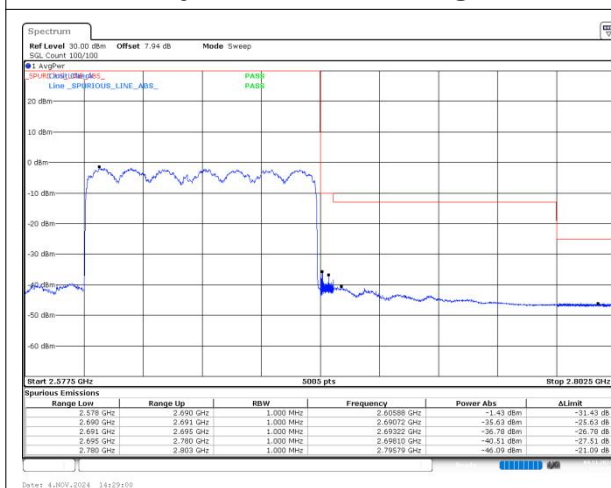


n41 SCS=30kHz DFT_QPSK BW=90MHz
HighChannel=528996 RB=243@0

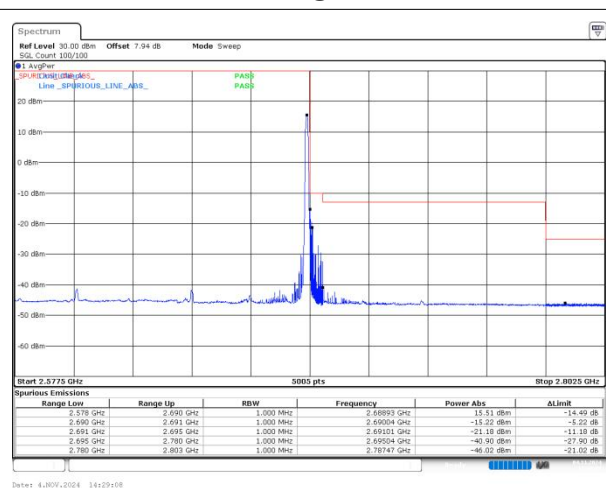


n41 SCS=30kHz DFT_16QAM BW=90MHz HighChannel=528996
RB=1@244

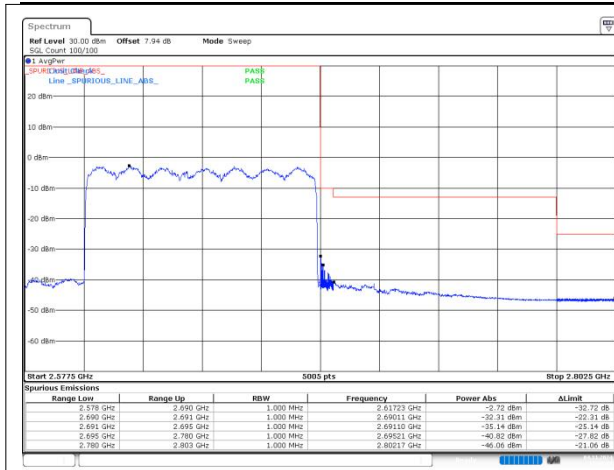


n41 SCS=30kHz DFT_16QAM BW=90MHz
HighChannel=528996 RB=243@0

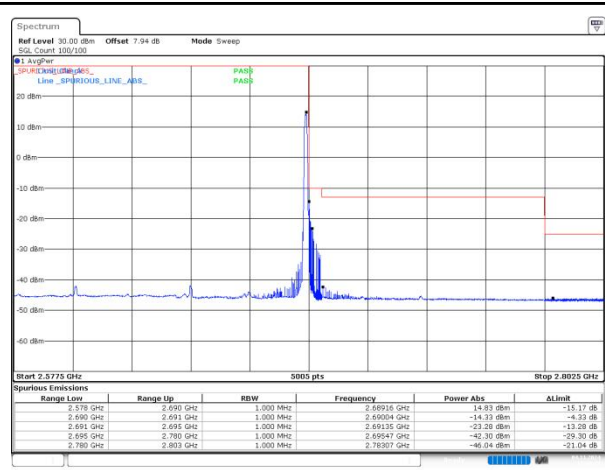


n41 SCS=30kHz DFT_64QAM BW=90MHz HighChannel=528996
RB=1@244

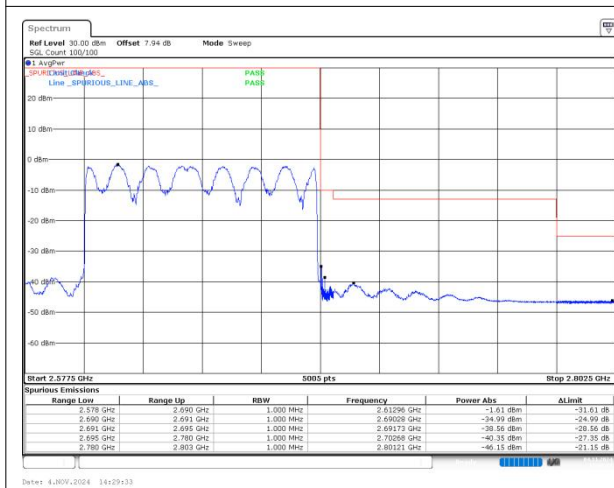


n41 SCS=30kHz DFT_64QAM BW=90MHz
HighChannel=528996 RB=243@0

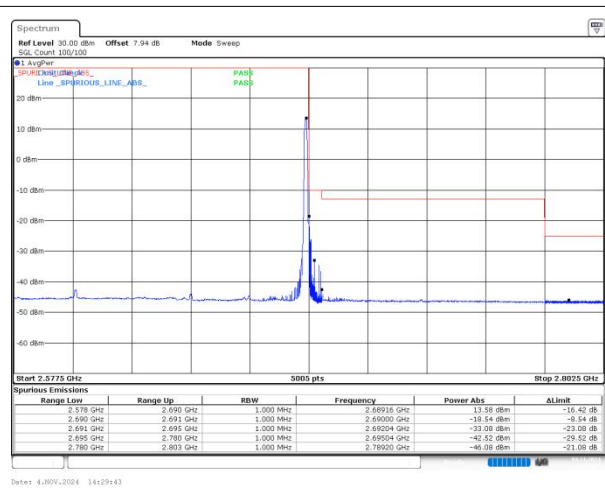


n41 SCS=30kHz DFT_256QAM BW=90MHz HighChannel=528996
RB=1@244

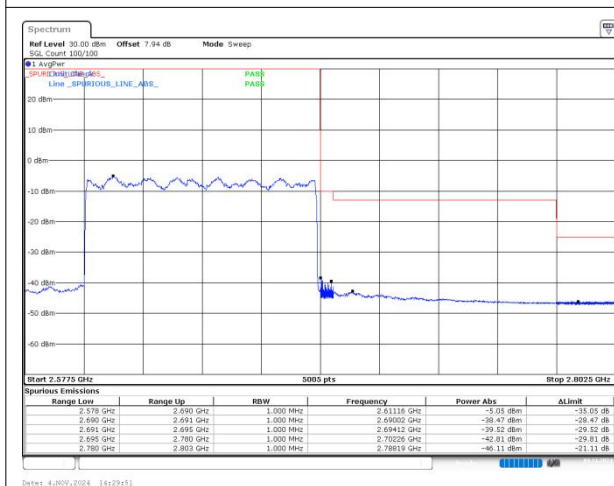

n41 SCS=30kHz DFT_256QAM BW=90MHz
HighChannel=528996 RB=243@0

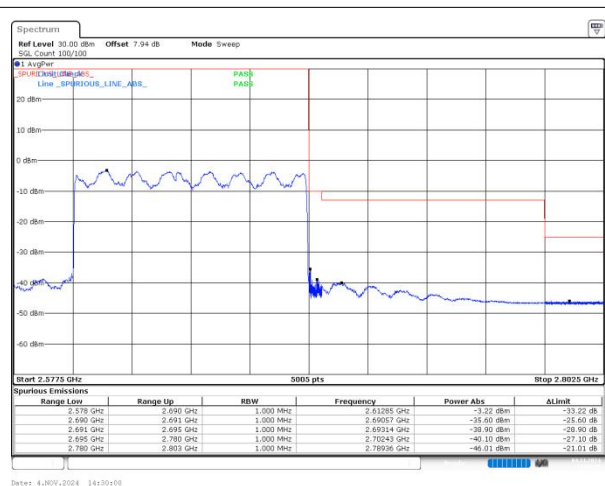


n41 SCS=30kHz CP_QPSK BW=90MHz HighChannel=528996
RB=245@0

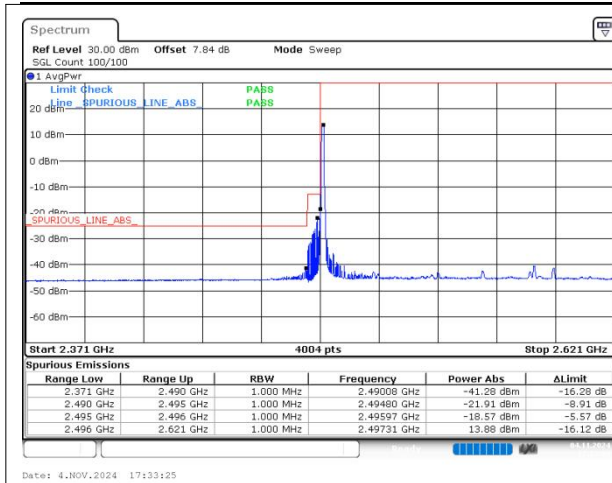


Date: 4.NOV.2024 17:33:25

n41 SCS=30kHz DFT_BPSK BW=100MHz
LowChannel=509202 RB=1@0

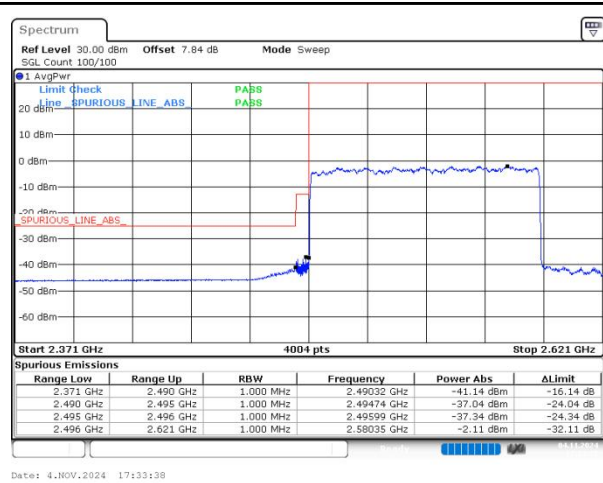


Date: 4.NOV.2024 17:33:38

n41 SCS=30kHz DFT_BPSK BW=100MHz LowChannel=509202
RB=270@0

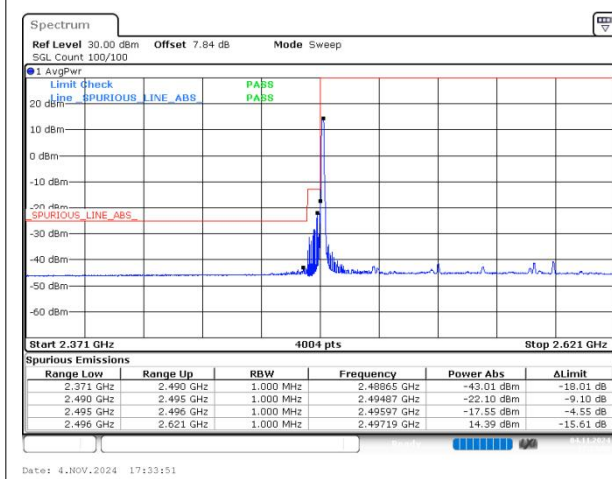


Date: 4.NOV.2024 17:33:51

n41 SCS=30kHz DFT_QPSK BW=100MHz
LowChannel=509202 RB=1@0

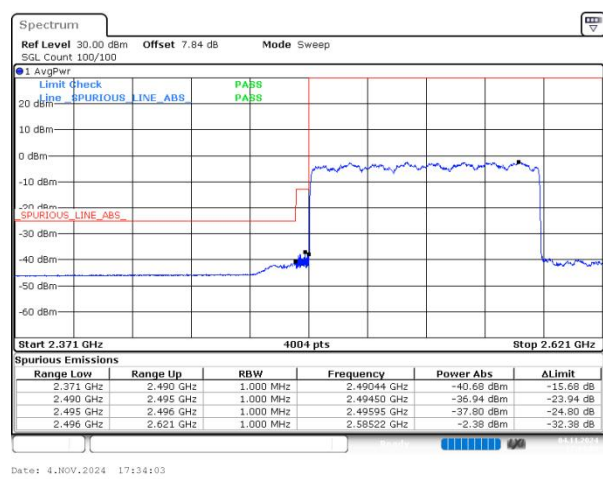


Date: 4.NOV.2024 17:34:03

n41 SCS=30kHz DFT_QPSK BW=100MHz LowChannel=509202
RB=270@0

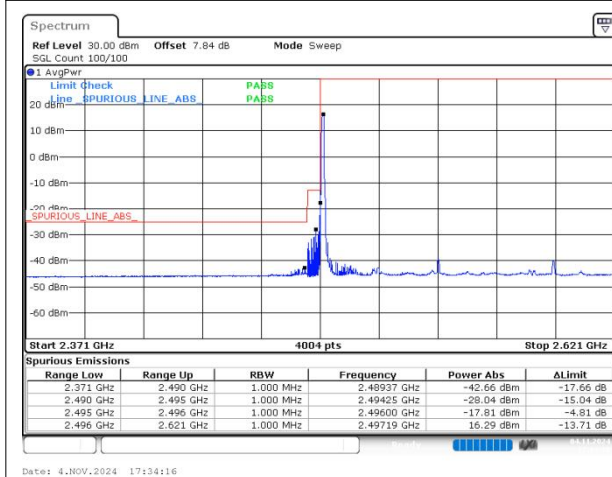


Date: 4.NOV.2024 17:34:16

n41 SCS=30kHz DFT_16QAM BW=100MHz
LowChannel=509202 RB=1@0

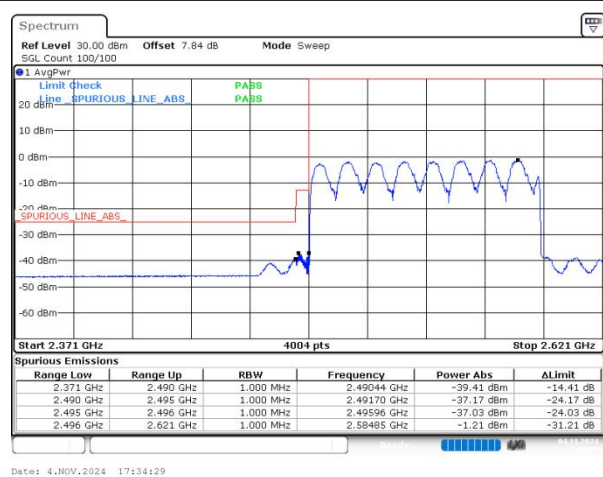


Date: 4.NOV.2024 17:34:29

n41 SCS=30kHz DFT_16QAM BW=100MHz LowChannel=509202
RB=270@0

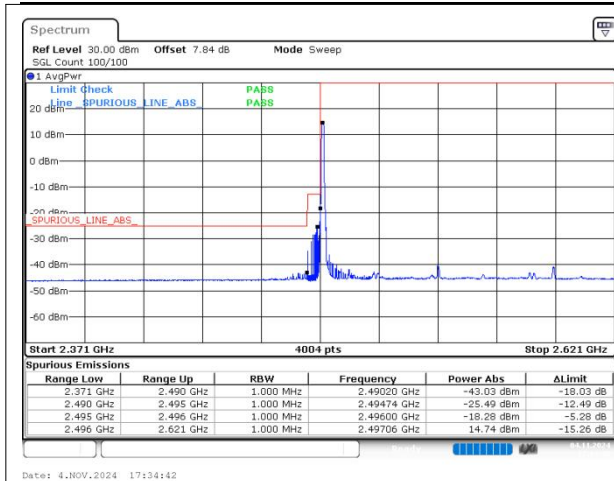


Date: 4.NOV.2024 17:34:42

n41 SCS=30kHz DFT_64QAM BW=100MHz
LowChannel=509202 RB=1@0

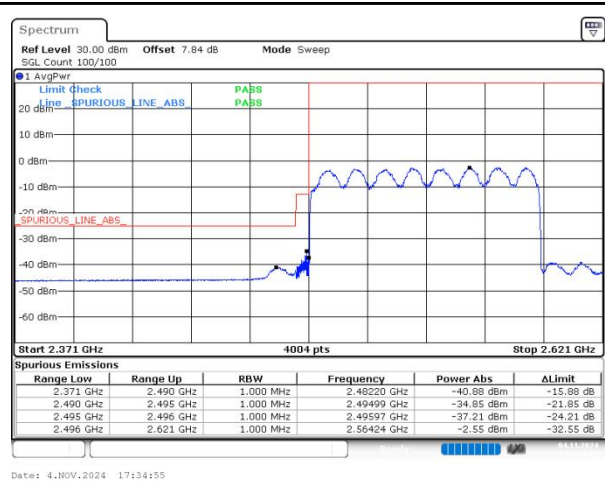


Date: 4.NOV.2024 17:34:55

n41 SCS=30kHz DFT_64QAM BW=100MHz LowChannel=509202
RB=270@0

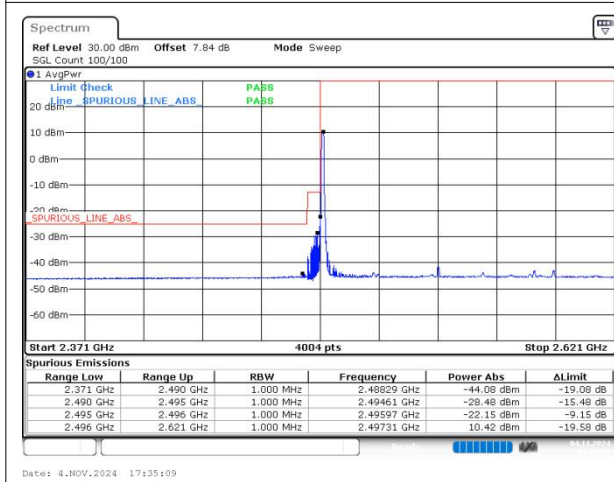


Date: 4.NOV.2024 17:35:09

n41 SCS=30kHz DFT_256QAM BW=100MHz
LowChannel=509202 RB=1@0

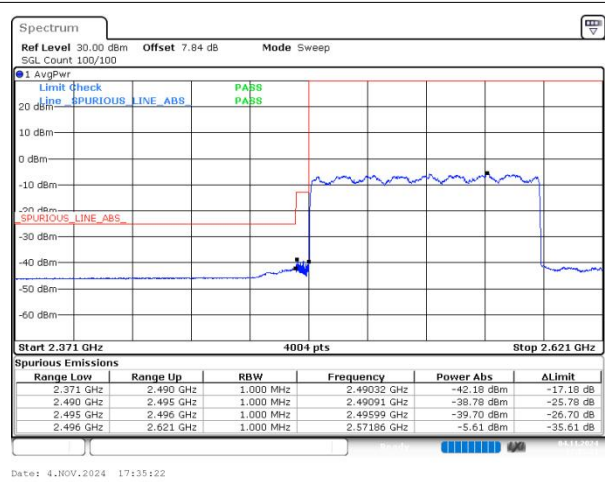


Date: 4.NOV.2024 17:35:12

n41 SCS=30kHz DFT_256QAM BW=100MHz LowChannel=509202
RB=270@0

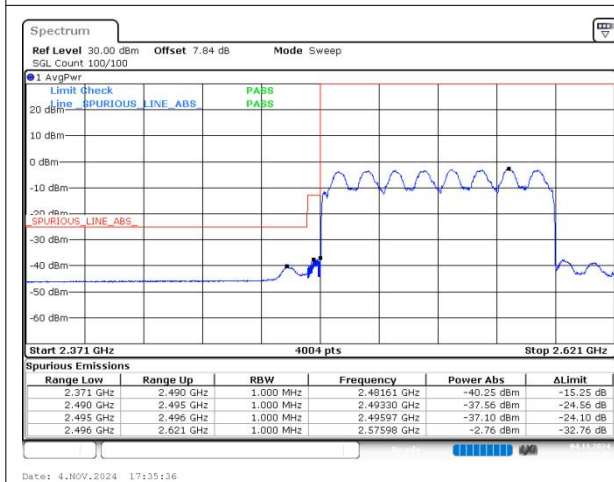

Date: 4.NOV.2024 17:35:36

n41 SCS=30kHz CP_QPSK BW=100MHz
LowChannel=509202 RB=273@0

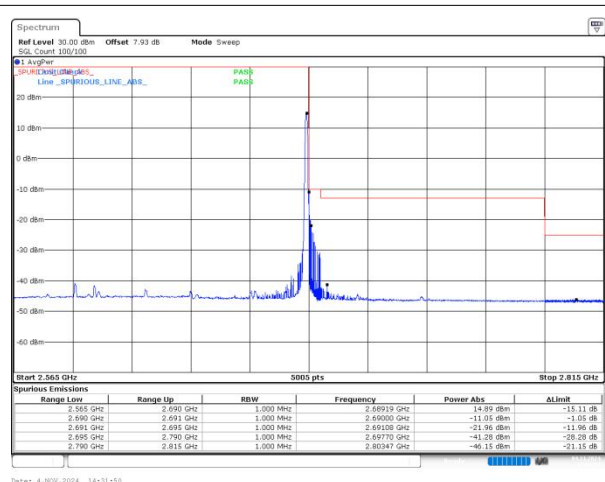

Date: 4.NOV.2024 18:33:58

n41 SCS=30kHz DFT_BPSK BW=100MHz HighChannel=528000
RB=1@272