

Appendix Test Data

Report No:	1816C50010012503	Test Sample NO:	1-2-2
Start Test Date:	2025-06-27	Finish Test Date:	2025-07-2
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.3°C	Relative Humidity:	56%
Pressure:	101 kPa		

Appendix A: Conducted Output Power for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Conducted Power(dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1	0	Low	22.53	PASS
Band4	1.4MHz	QPSK	19957	1	5	Low	22.06	PASS
Band4	1.4MHz	QPSK	19957	6	0	Low	20.02	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	21.46	PASS
Band4	1.4MHz	16QAM	19957	1	5	Low	21.09	PASS
Band4	1.4MHz	16QAM	19957	6	0	Low	20.02	PASS
Band4	1.4MHz	QPSK	20175	1	0	Low	22.45	PASS
Band4	1.4MHz	QPSK	20175	1	5	Low	22.19	PASS
Band4	1.4MHz	QPSK	20175	6	0	Low	19.90	PASS
Band4	1.4MHz	16QAM	20175	1	0	Low	20.97	PASS
Band4	1.4MHz	16QAM	20175	1	5	Low	20.82	PASS
Band4	1.4MHz	16QAM	20175	6	0	Low	20.10	PASS
Band4	1.4MHz	QPSK	20393	1	0	High	22.13	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	21.94	PASS
Band4	1.4MHz	QPSK	20393	6	0	High	19.72	PASS
Band4	1.4MHz	16QAM	20393	1	0	High	20.72	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	20.45	PASS
Band4	1.4MHz	16QAM	20393	6	0	High	19.80	PASS
Band4	3MHz	QPSK	19965	1	0	Low	22.22	PASS
Band4	3MHz	QPSK	19965	1	5	Low	22.11	PASS
Band4	3MHz	QPSK	19965	6	0	Low	19.91	PASS
Band4	3MHz	16QAM	19965	1	0	Low	20.85	PASS
Band4	3MHz	16QAM	19965	1	5	Low	20.66	PASS
Band4	3MHz	16QAM	19965	6	0	Low	20.10	PASS
Band4	3MHz	QPSK	20175	1	0	Low	22.45	PASS
Band4	3MHz	QPSK	20175	1	5	Low	22.22	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	3MHz	QPSK	20175	6	0	Low	19.97	PASS
Band4	3MHz	16QAM	20175	1	0	Low	21.06	PASS
Band4	3MHz	16QAM	20175	1	5	Low	20.93	PASS
Band4	3MHz	16QAM	20175	6	0	Low	20.14	PASS
Band4	3MHz	QPSK	20385	1	0	High	22.11	PASS
Band4	3MHz	QPSK	20385	1	5	High	22.02	PASS
Band4	3MHz	QPSK	20385	6	0	High	19.76	PASS
Band4	3MHz	16QAM	20385	1	0	High	20.90	PASS
Band4	3MHz	16QAM	20385	1	5	High	20.48	PASS
Band4	3MHz	16QAM	20385	6	0	High	19.84	PASS
Band4	5MHz	QPSK	19975	1	0	Low	22.22	PASS
Band4	5MHz	QPSK	19975	1	5	Low	21.96	PASS
Band4	5MHz	QPSK	19975	6	0	Low	20.99	PASS
Band4	5MHz	16QAM	19975	1	0	Low	21.74	PASS
Band4	5MHz	16QAM	19975	1	5	Low	21.63	PASS
Band4	5MHz	16QAM	19975	6	0	Low	20.98	PASS
Band4	5MHz	QPSK	20175	1	0	Low	22.24	PASS
Band4	5MHz	QPSK	20175	1	5	Low	22.18	PASS
Band4	5MHz	QPSK	20175	6	0	Low	21.15	PASS
Band4	5MHz	16QAM	20175	1	0	Low	21.82	PASS
Band4	5MHz	16QAM	20175	1	5	Low	21.67	PASS
Band4	5MHz	16QAM	20175	6	0	Low	21.14	PASS
Band4	5MHz	QPSK	20375	1	0	High	22.11	PASS
Band4	5MHz	QPSK	20375	1	5	High	21.87	PASS
Band4	5MHz	QPSK	20375	6	0	High	20.90	PASS
Band4	5MHz	16QAM	20375	1	0	High	21.68	PASS
Band4	5MHz	16QAM	20375	1	5	High	21.57	PASS
Band4	5MHz	16QAM	20375	6	0	High	20.81	PASS
Band4	10MHz	QPSK	20000	1	0	Low	21.99	PASS
Band4	10MHz	QPSK	20000	1	5	Low	21.86	PASS
Band4	10MHz	QPSK	20000	6	0	Low	20.84	PASS
Band4	10MHz	16QAM	20000	1	0	Low	21.75	PASS
Band4	10MHz	16QAM	20000	1	5	Low	21.60	PASS
Band4	10MHz	16QAM	20000	6	0	Low	20.84	PASS
Band4	10MHz	QPSK	20175	1	0	Low	22.15	PASS
Band4	10MHz	QPSK	20175	1	5	Low	22.08	PASS
Band4	10MHz	QPSK	20175	6	0	Low	20.95	PASS
Band4	10MHz	16QAM	20175	1	0	Low	21.73	PASS
Band4	10MHz	16QAM	20175	1	5	Low	21.65	PASS
Band4	10MHz	16QAM	20175	6	0	Low	20.95	PASS
Band4	10MHz	QPSK	20350	1	0	High	22.10	PASS
Band4	10MHz	QPSK	20350	1	5	High	21.90	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	10MHz	QPSK	20350	6	0	High	20.77	PASS
Band4	10MHz	16QAM	20350	1	0	High	21.67	PASS
Band4	10MHz	16QAM	20350	1	5	High	21.49	PASS
Band4	10MHz	16QAM	20350	6	0	High	20.76	PASS
Band4	15MHz	QPSK	20025	1	0	Low	22.06	PASS
Band4	15MHz	QPSK	20025	1	5	Low	21.86	PASS
Band4	15MHz	QPSK	20025	6	0	Low	21.78	PASS
Band4	15MHz	16QAM	20025	1	0	Low	21.74	PASS
Band4	15MHz	16QAM	20025	1	5	Low	21.51	PASS
Band4	15MHz	16QAM	20025	6	0	Low	22.02	PASS
Band4	15MHz	QPSK	20175	1	0	Low	22.12	PASS
Band4	15MHz	QPSK	20175	1	5	Low	22.07	PASS
Band4	15MHz	QPSK	20175	6	0	Low	21.99	PASS
Band4	15MHz	16QAM	20175	1	0	Low	21.73	PASS
Band4	15MHz	16QAM	20175	1	5	Low	21.59	PASS
Band4	15MHz	16QAM	20175	6	0	Low	22.02	PASS
Band4	15MHz	QPSK	20325	1	0	High	22.03	PASS
Band4	15MHz	QPSK	20325	1	5	High	21.86	PASS
Band4	15MHz	QPSK	20325	6	0	High	21.74	PASS
Band4	15MHz	16QAM	20325	1	0	High	21.61	PASS
Band4	15MHz	16QAM	20325	1	5	High	21.56	PASS
Band4	15MHz	16QAM	20325	6	0	High	21.83	PASS
Band4	20MHz	QPSK	20050	1	0	Low	21.97	PASS
Band4	20MHz	QPSK	20050	1	5	Low	21.76	PASS
Band4	20MHz	QPSK	20050	6	0	Low	21.68	PASS
Band4	20MHz	16QAM	20050	1	0	Low	21.66	PASS
Band4	20MHz	16QAM	20050	1	5	Low	21.52	PASS
Band4	20MHz	16QAM	20050	6	0	Low	21.94	PASS
Band4	20MHz	QPSK	20175	1	0	Low	22.03	PASS
Band4	20MHz	QPSK	20175	1	5	Low	22.13	PASS
Band4	20MHz	QPSK	20175	6	0	Low	21.86	PASS
Band4	20MHz	16QAM	20175	1	0	Low	21.66	PASS
Band4	20MHz	16QAM	20175	1	5	Low	21.70	PASS
Band4	20MHz	16QAM	20175	6	0	Low	21.91	PASS
Band4	20MHz	QPSK	20300	1	0	High	22.06	PASS
Band4	20MHz	QPSK	20300	1	5	High	21.97	PASS
Band4	20MHz	QPSK	20300	6	0	High	21.89	PASS
Band4	20MHz	16QAM	20300	1	0	High	21.69	PASS
Band4	20MHz	16QAM	20300	1	5	High	21.52	PASS
Band4	20MHz	16QAM	20300	6	0	High	21.88	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF) for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Result(dB)	Limit(dB)	Verdict
Band4	1.4MHz	QPSK	19957	1	0	Low	1.98	<=13	PASS
Band4	1.4MHz	QPSK	19957	6	0	Low	4.43	<=13	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	3.40	<=13	PASS
Band4	1.4MHz	16QAM	19957	6	0	Low	4.43	<=13	PASS
Band4	1.4MHz	QPSK	20175	1	0	Low	1.70	<=13	PASS
Band4	1.4MHz	QPSK	20175	6	0	Low	4.23	<=13	PASS
Band4	1.4MHz	16QAM	20175	1	0	Low	3.15	<=13	PASS
Band4	1.4MHz	16QAM	20175	6	0	Low	4.23	<=13	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	1.90	<=13	PASS
Band4	1.4MHz	QPSK	20393	6	0	High	4.64	<=13	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	3.03	<=13	PASS
Band4	1.4MHz	16QAM	20393	6	0	High	4.68	<=13	PASS
Band4	3MHz	QPSK	19965	1	0	Low	1.98	<=13	PASS
Band4	3MHz	QPSK	19965	6	0	Low	4.05	<=13	PASS
Band4	3MHz	16QAM	19965	1	0	Low	3.28	<=13	PASS
Band4	3MHz	16QAM	19965	6	0	Low	4.05	<=13	PASS
Band4	3MHz	QPSK	20175	1	0	Low	1.62	<=13	PASS
Band4	3MHz	QPSK	20175	6	0	Low	3.81	<=13	PASS
Band4	3MHz	16QAM	20175	1	0	Low	2.91	<=13	PASS
Band4	3MHz	16QAM	20175	6	0	Low	3.84	<=13	PASS
Band4	3MHz	QPSK	20385	1	5	High	1.55	<=13	PASS
Band4	3MHz	QPSK	20385	6	0	High	3.64	<=13	PASS
Band4	3MHz	16QAM	20385	1	5	High	3.01	<=13	PASS
Band4	3MHz	16QAM	20385	6	0	High	3.67	<=13	PASS
Band4	5MHz	QPSK	19975	1	0	Low	3.03	<=13	PASS
Band4	5MHz	QPSK	19975	6	0	Low	4.39	<=13	PASS
Band4	5MHz	16QAM	19975	1	0	Low	2.64	<=13	PASS
Band4	5MHz	16QAM	19975	6	0	Low	4.43	<=13	PASS
Band4	5MHz	QPSK	20175	1	0	Low	2.84	<=13	PASS
Band4	5MHz	QPSK	20175	6	0	Low	4.05	<=13	PASS
Band4	5MHz	16QAM	20175	1	0	Low	2.41	<=13	PASS
Band4	5MHz	16QAM	20175	6	0	Low	4.09	<=13	PASS
Band4	5MHz	QPSK	20375	1	5	High	2.34	<=13	PASS
Band4	5MHz	QPSK	20375	6	0	High	3.61	<=13	PASS
Band4	5MHz	16QAM	20375	1	5	High	2.38	<=13	PASS
Band4	5MHz	16QAM	20375	6	0	High	3.61	<=13	PASS
Band4	10MHz	QPSK	20000	1	0	Low	2.16	<=13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band4	10MHz	QPSK	20000	6	0	Low	3.34	<=13	PASS
Band4	10MHz	16QAM	20000	1	0	Low	2.64	<=13	PASS
Band4	10MHz	16QAM	20000	6	0	Low	3.36	<=13	PASS
Band4	10MHz	QPSK	20175	1	0	Low	1.97	<=13	PASS
Band4	10MHz	QPSK	20175	6	0	Low	3.08	<=13	PASS
Band4	10MHz	16QAM	20175	1	0	Low	2.39	<=13	PASS
Band4	10MHz	16QAM	20175	6	0	Low	3.10	<=13	PASS
Band4	10MHz	QPSK	20350	1	5	High	1.93	<=13	PASS
Band4	10MHz	QPSK	20350	6	0	High	2.99	<=13	PASS
Band4	10MHz	16QAM	20350	1	5	High	2.35	<=13	PASS
Band4	10MHz	16QAM	20350	6	0	High	3.00	<=13	PASS
Band4	15MHz	QPSK	20025	1	0	Low	2.18	<=13	PASS
Band4	15MHz	QPSK	20025	6	0	Low	2.53	<=13	PASS
Band4	15MHz	16QAM	20025	1	0	Low	2.65	<=13	PASS
Band4	15MHz	16QAM	20025	6	0	Low	2.50	<=13	PASS
Band4	15MHz	QPSK	20175	1	0	Low	1.89	<=13	PASS
Band4	15MHz	QPSK	20175	6	0	Low	2.25	<=13	PASS
Band4	15MHz	16QAM	20175	1	0	Low	2.43	<=13	PASS
Band4	15MHz	16QAM	20175	6	0	Low	2.26	<=13	PASS
Band4	15MHz	QPSK	20325	1	5	High	2.01	<=13	PASS
Band4	15MHz	QPSK	20325	6	0	High	2.15	<=13	PASS
Band4	15MHz	16QAM	20325	1	5	High	2.35	<=13	PASS
Band4	15MHz	16QAM	20325	6	0	High	2.17	<=13	PASS
Band4	20MHz	QPSK	20050	1	0	Low	2.23	<=13	PASS
Band4	20MHz	QPSK	20050	6	0	Low	2.46	<=13	PASS
Band4	20MHz	16QAM	20050	1	0	Low	2.67	<=13	PASS
Band4	20MHz	16QAM	20050	6	0	Low	2.56	<=13	PASS
Band4	20MHz	QPSK	20175	1	0	Low	2.05	<=13	PASS
Band4	20MHz	QPSK	20175	6	0	Low	2.24	<=13	PASS
Band4	20MHz	16QAM	20175	1	0	Low	2.50	<=13	PASS
Band4	20MHz	16QAM	20175	6	0	Low	2.26	<=13	PASS
Band4	20MHz	QPSK	20300	1	5	High	1.95	<=13	PASS
Band4	20MHz	QPSK	20300	6	0	High	2.10	<=13	PASS
Band4	20MHz	16QAM	20300	1	5	High	2.38	<=13	PASS
Band4	20MHz	16QAM	20300	6	0	High	2.13	<=13	PASS


Test Graphs

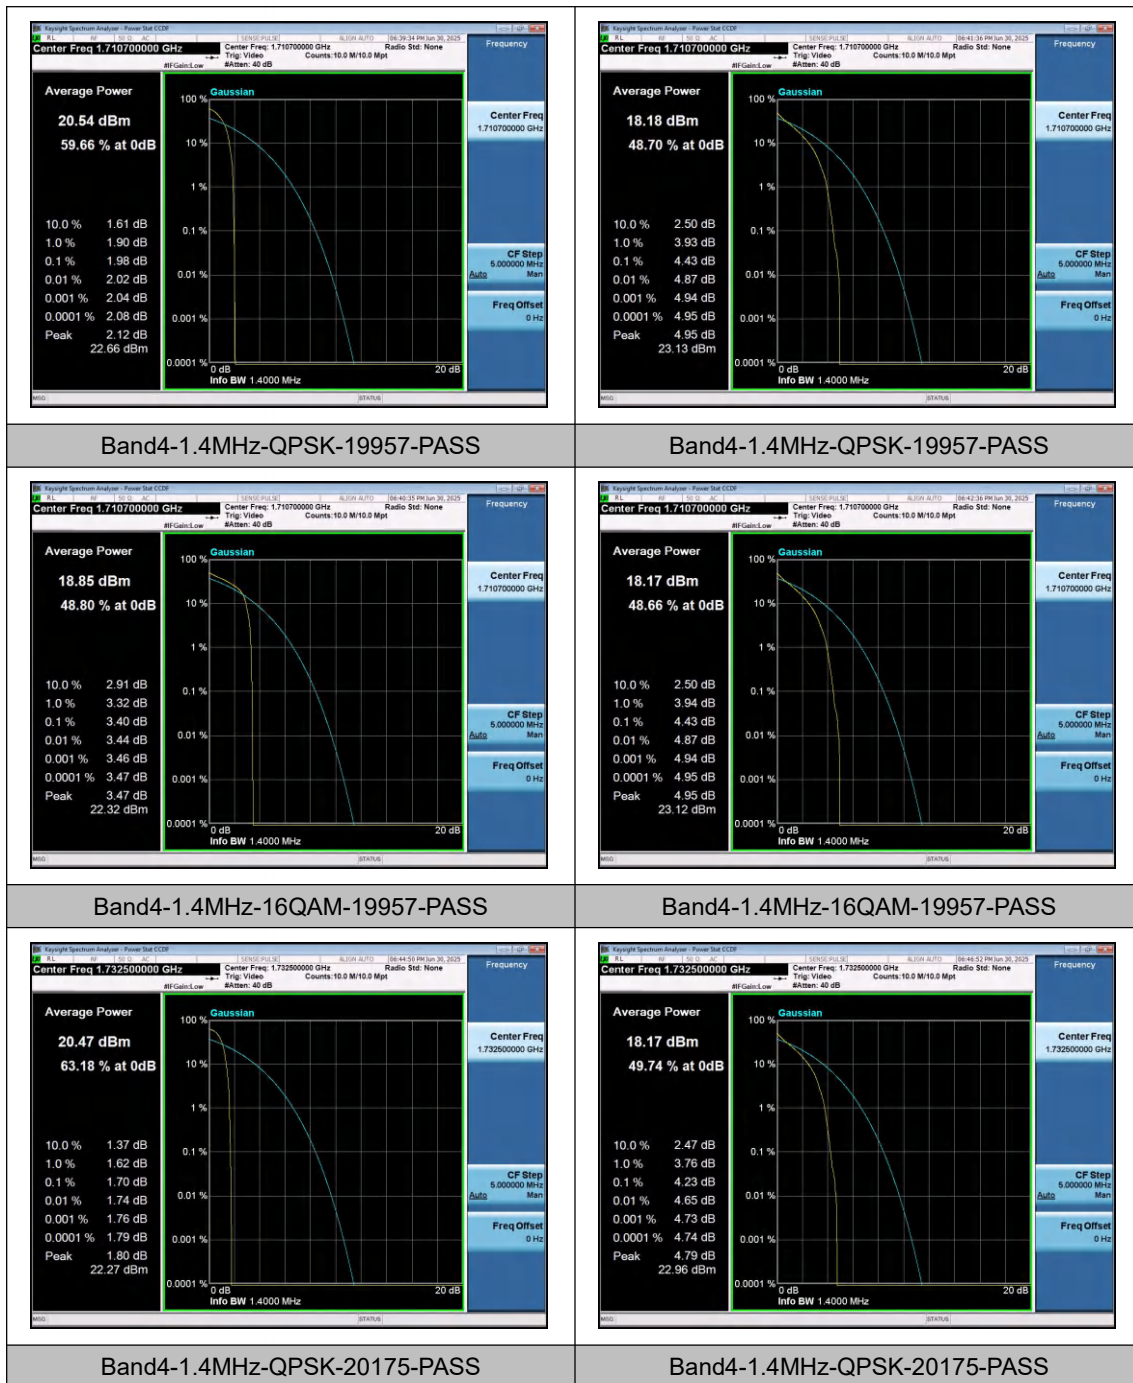


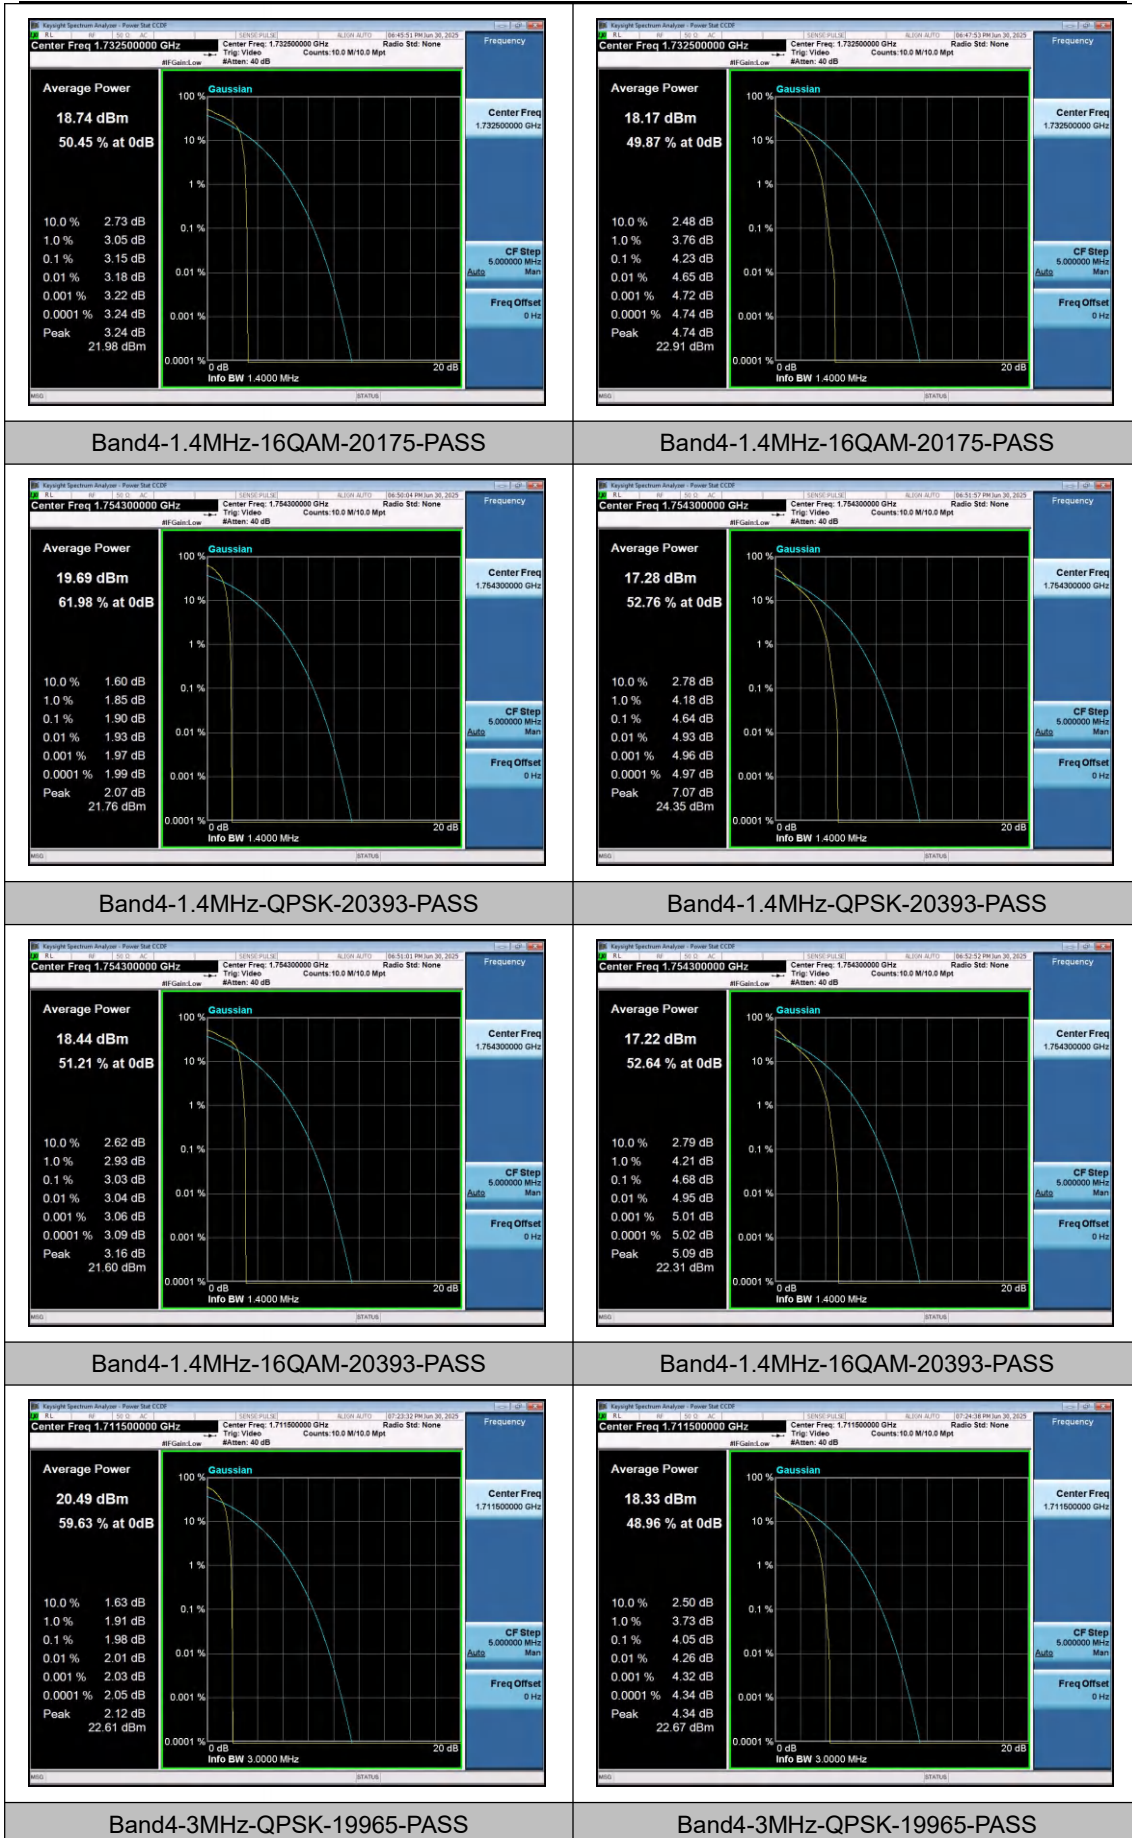


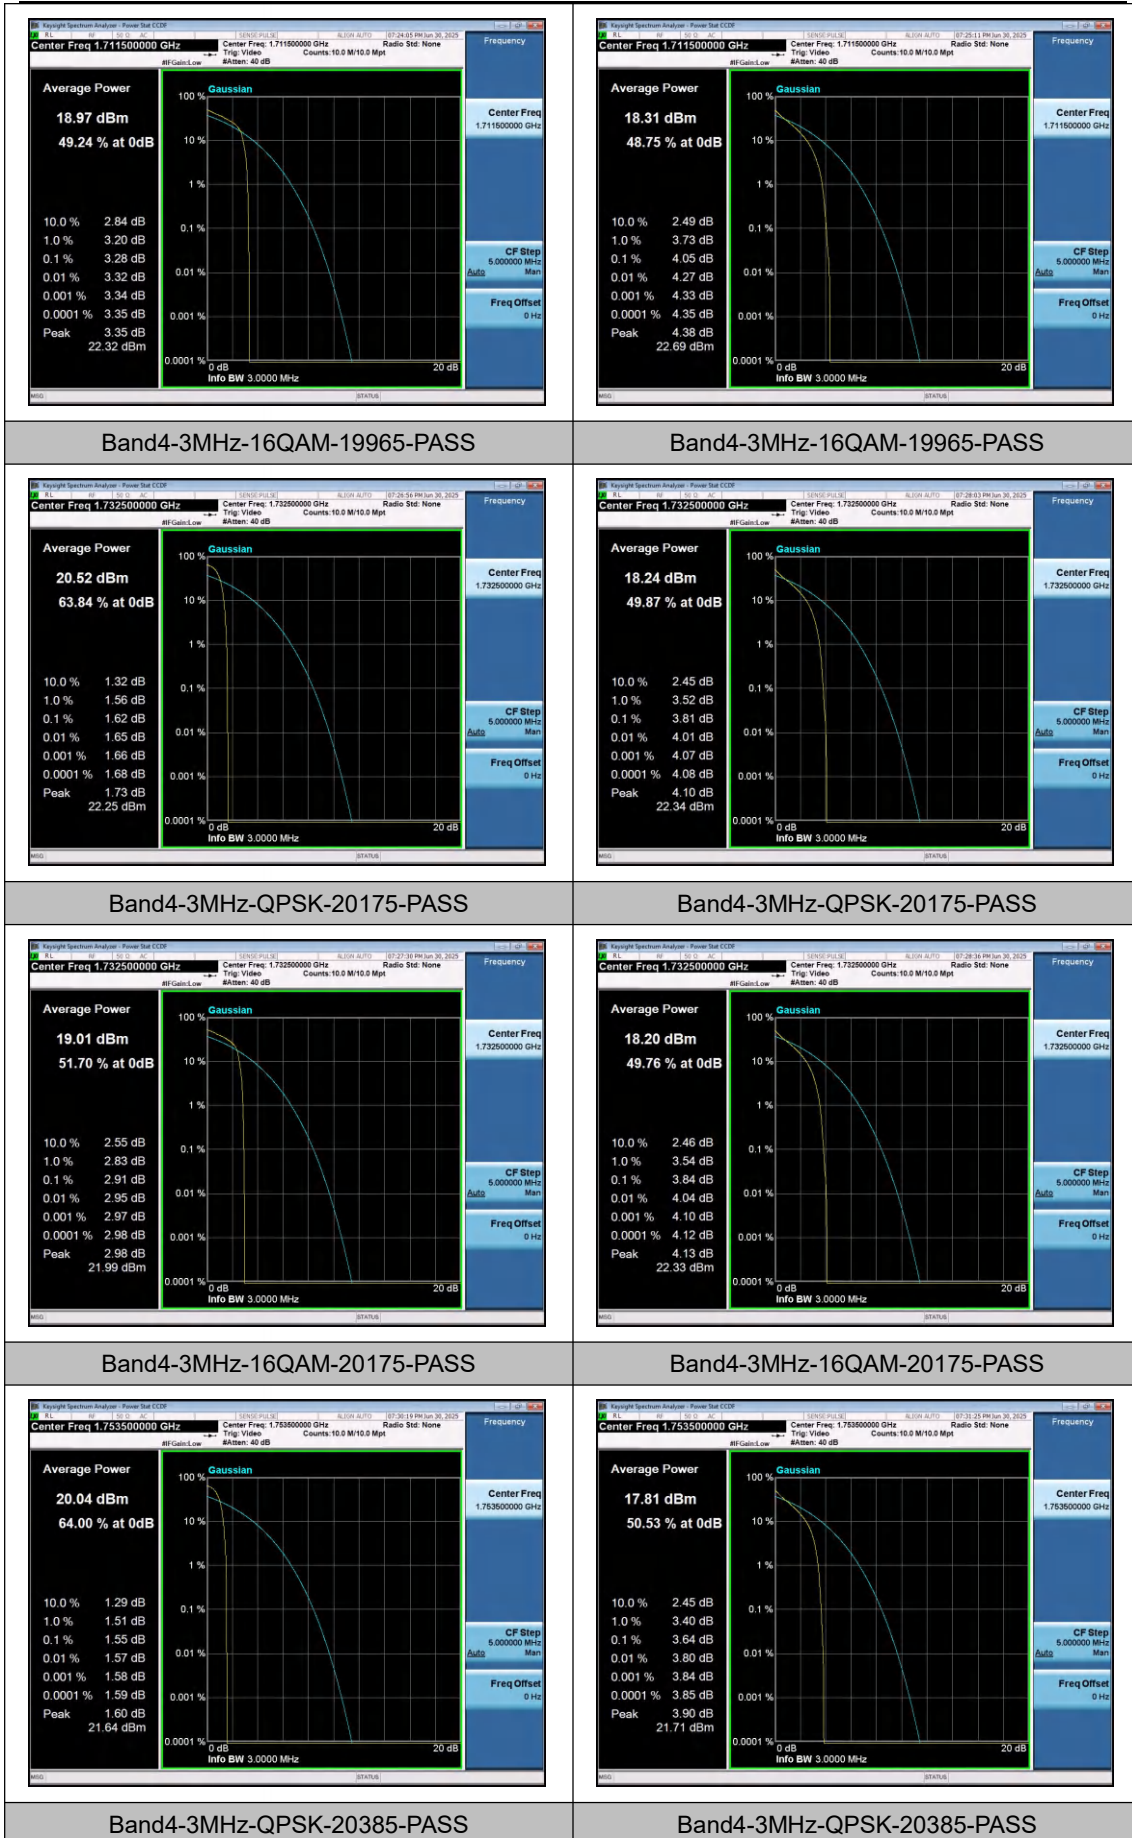


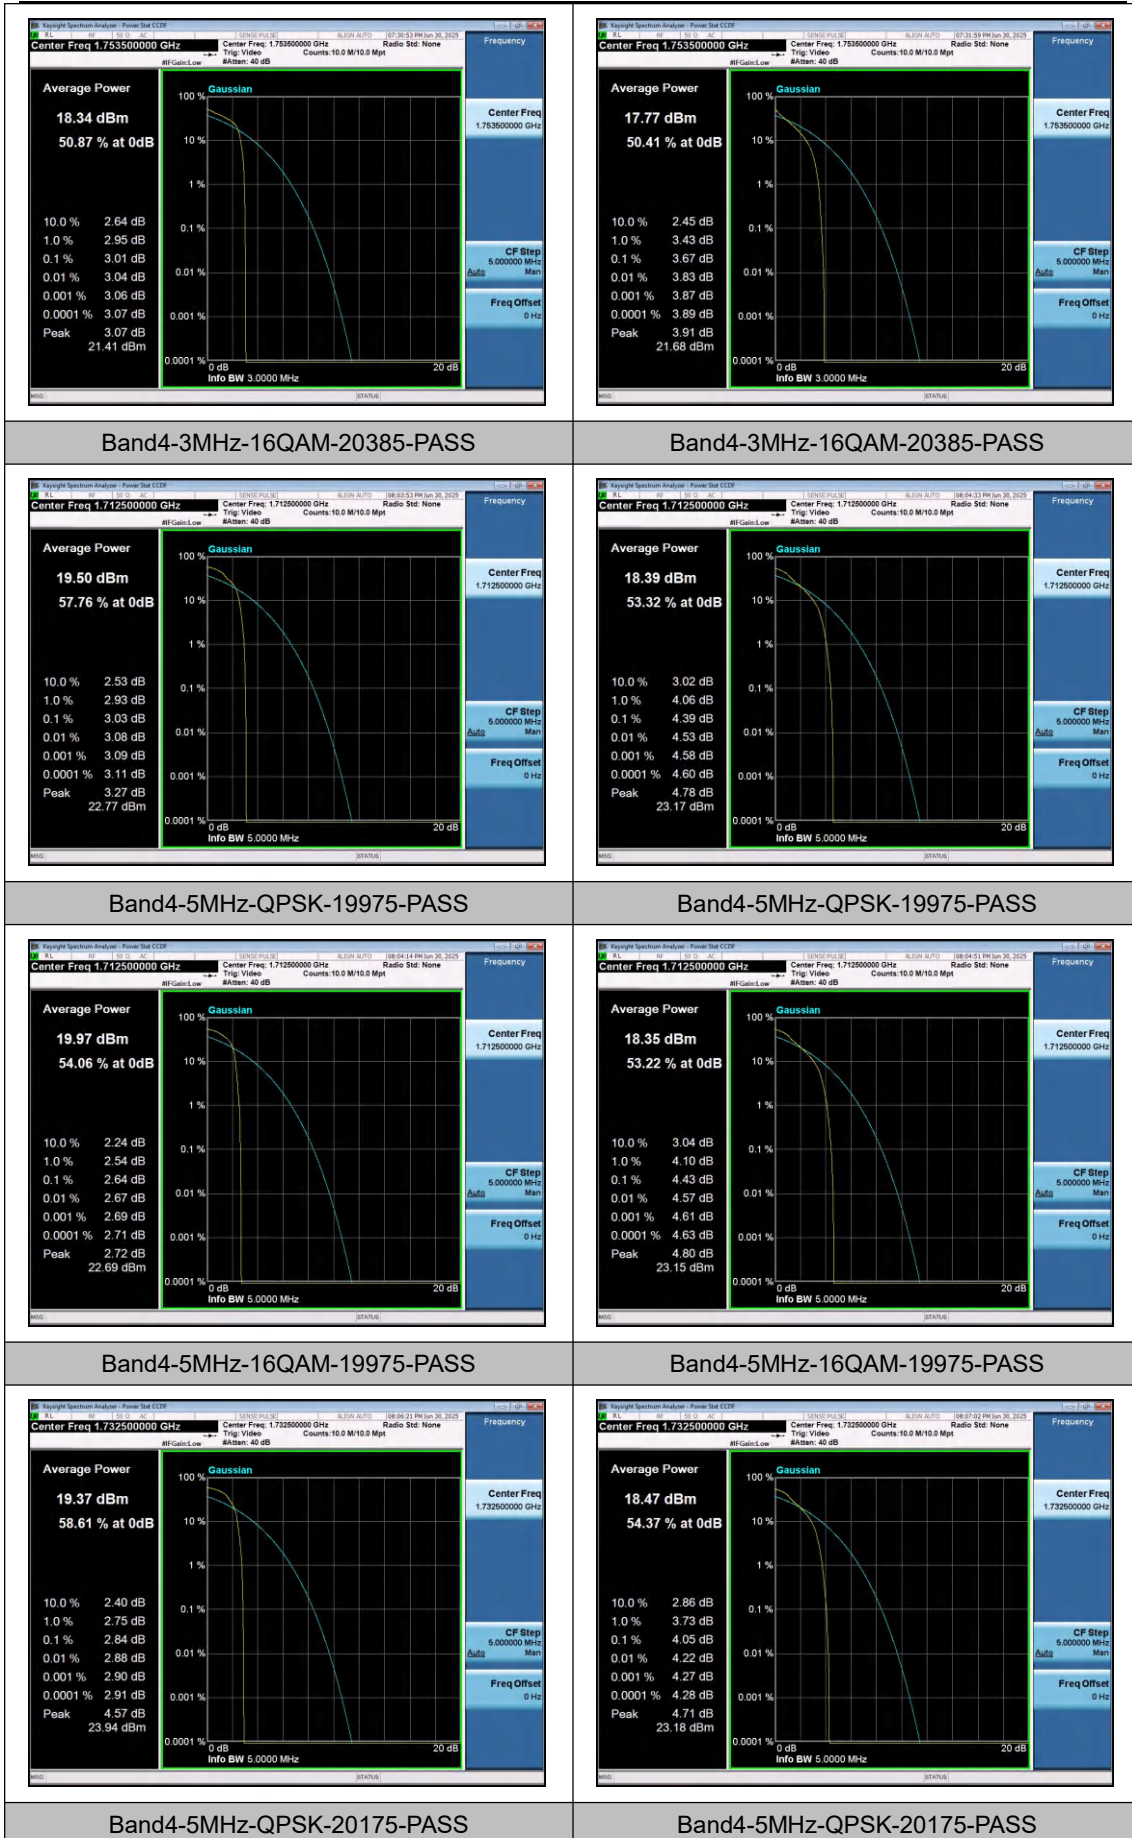


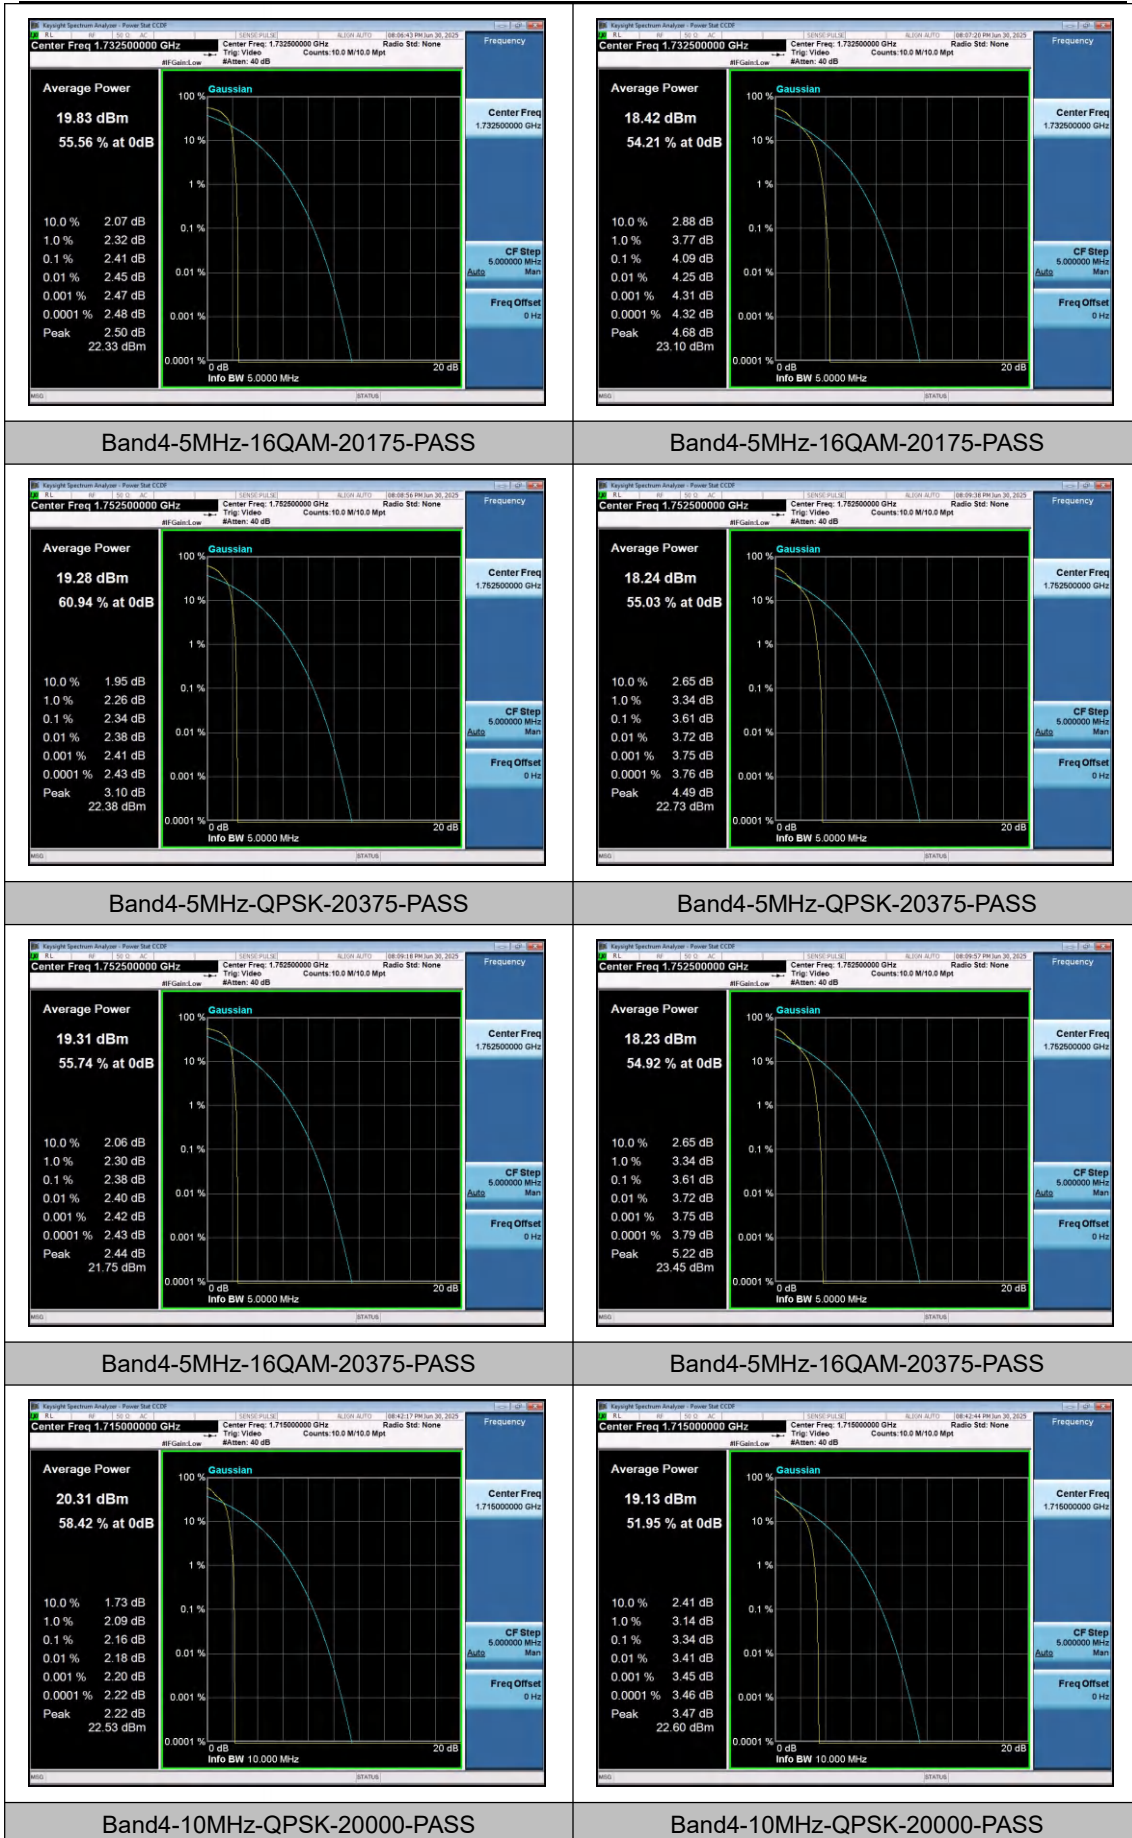


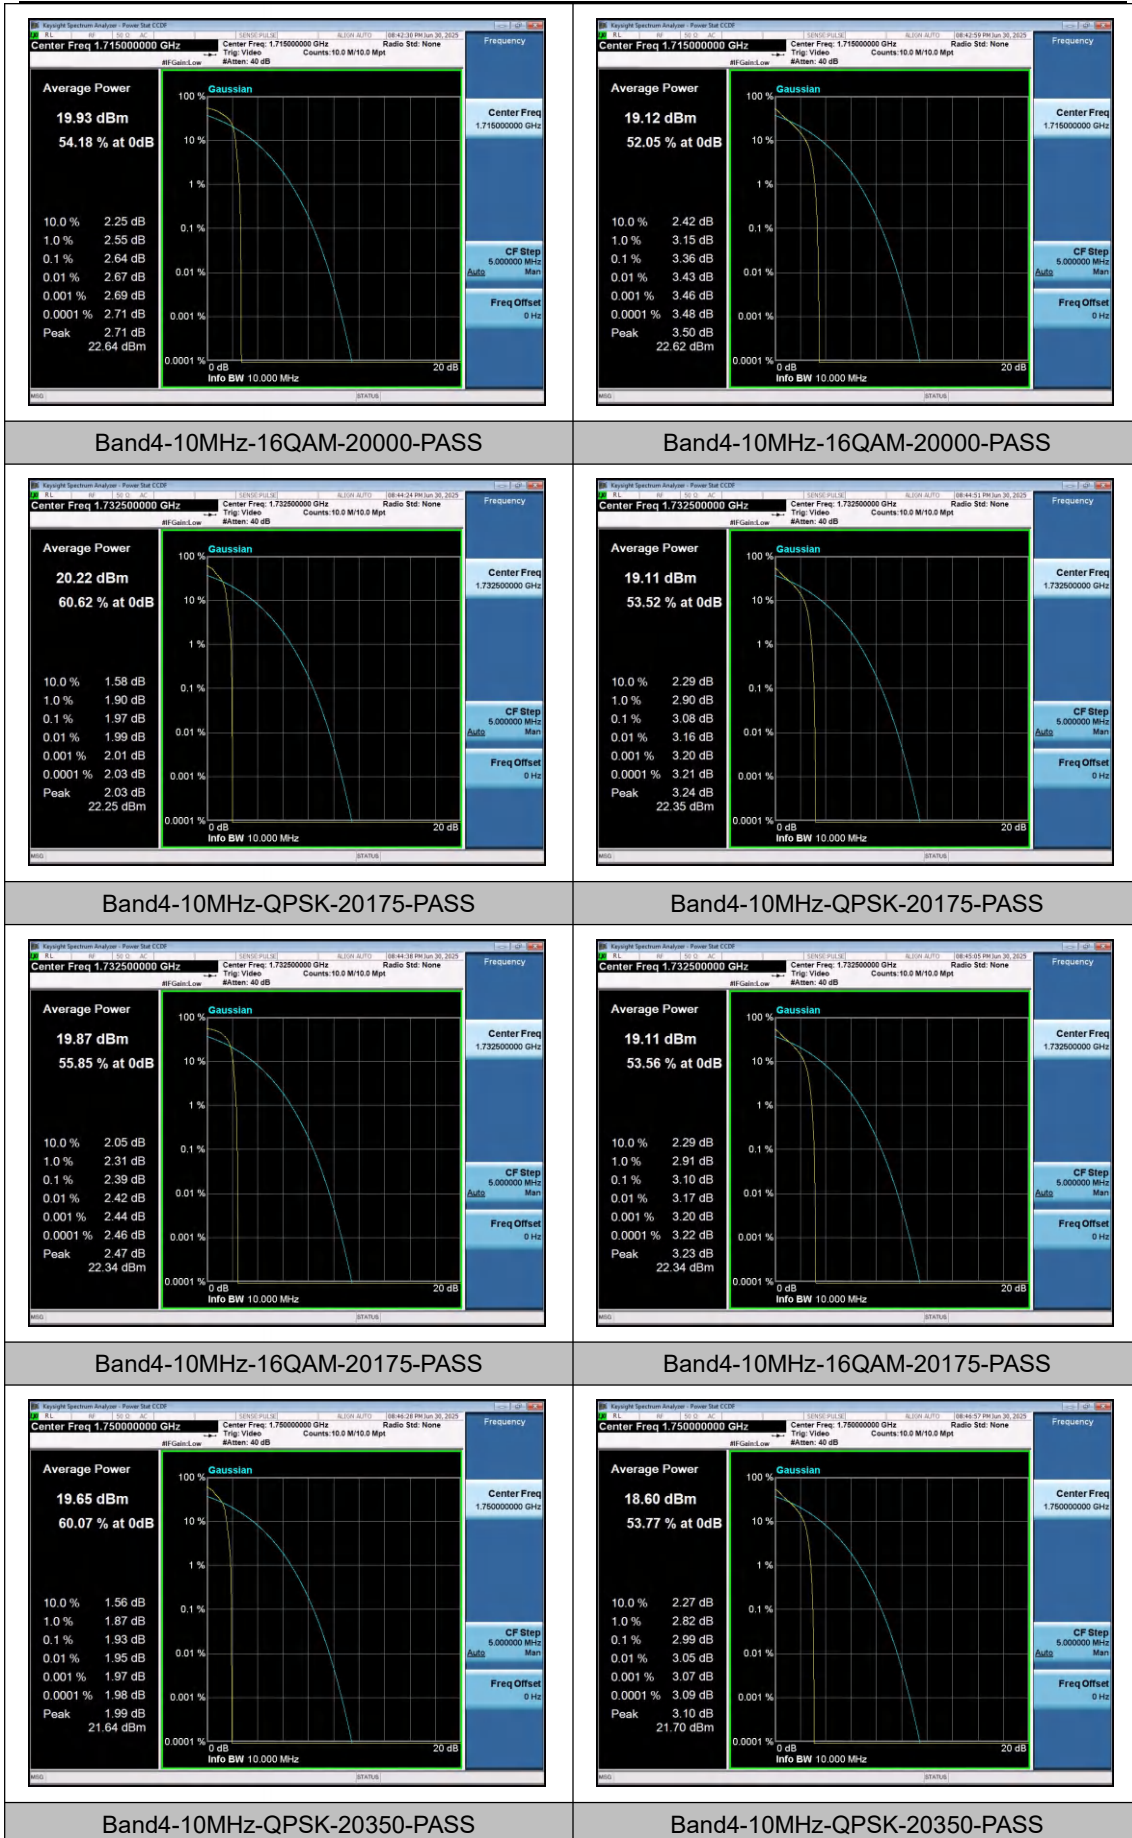

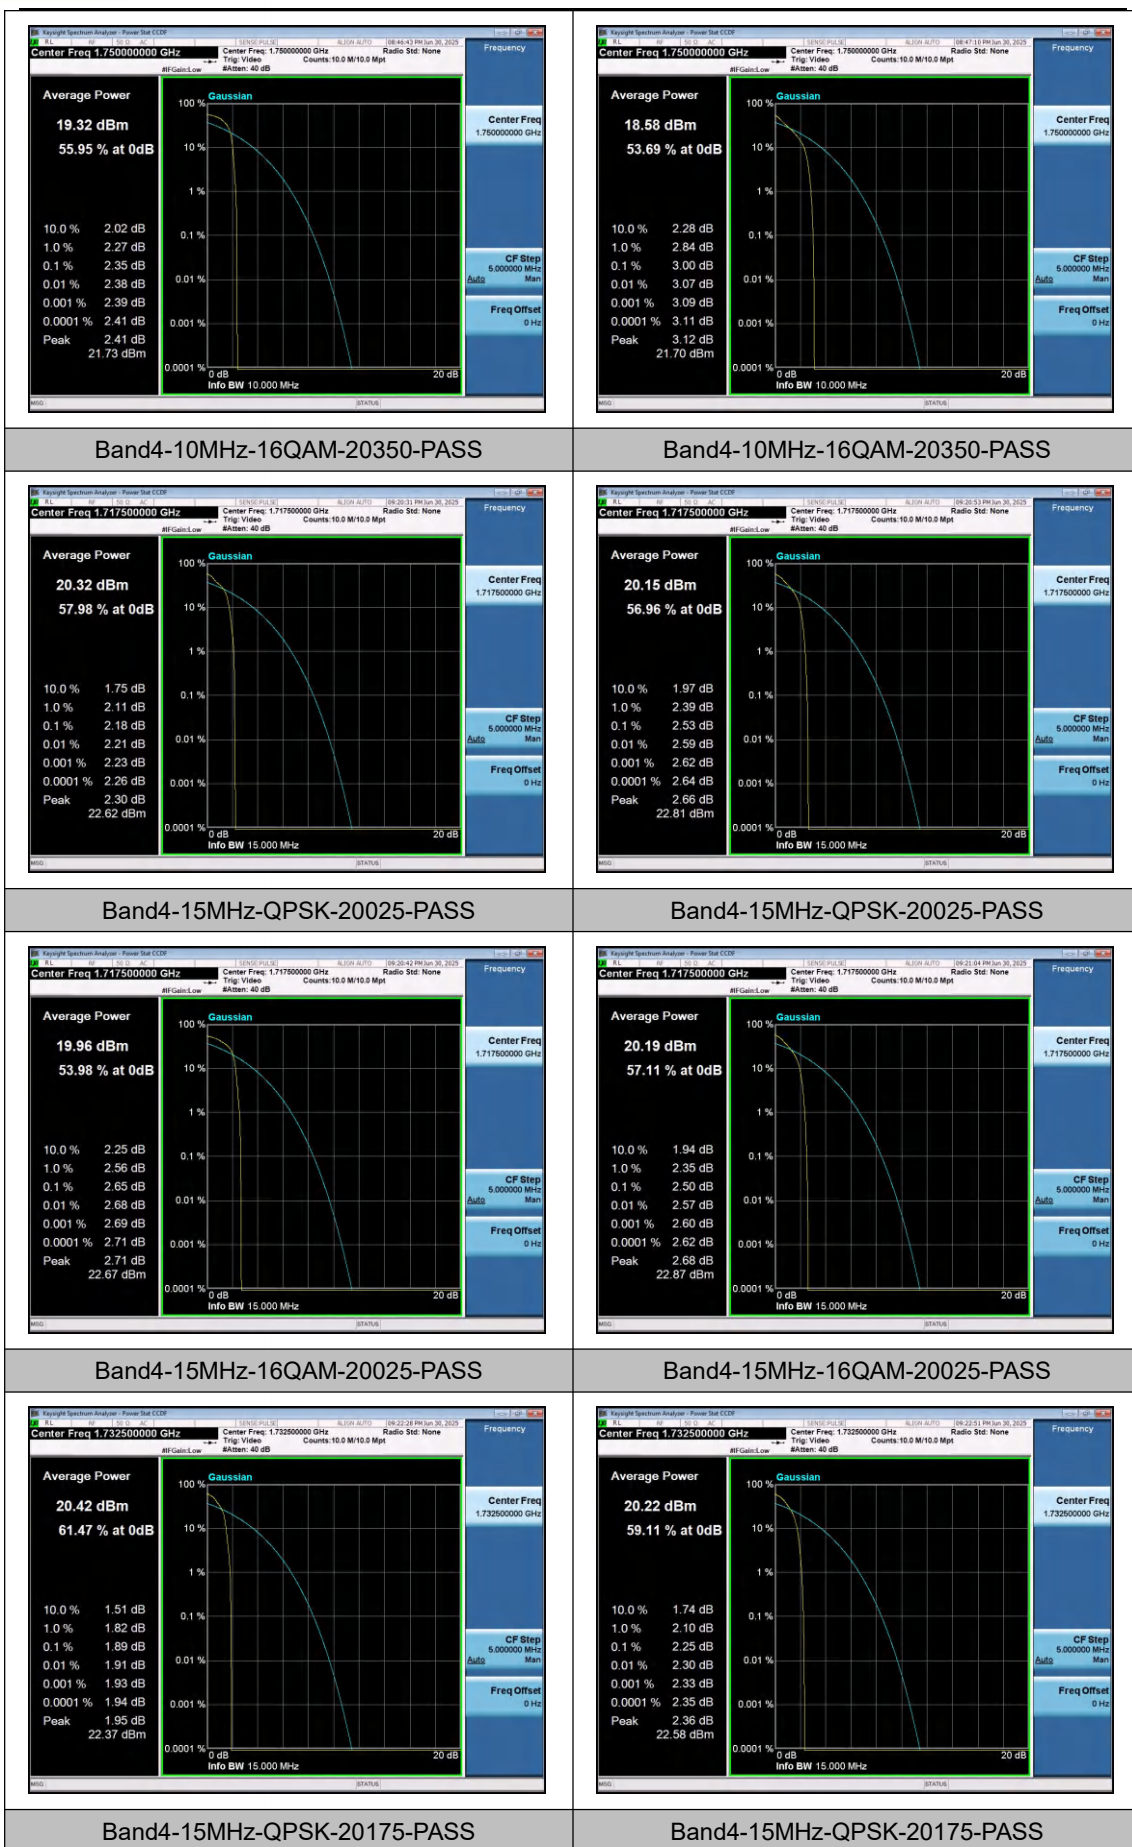

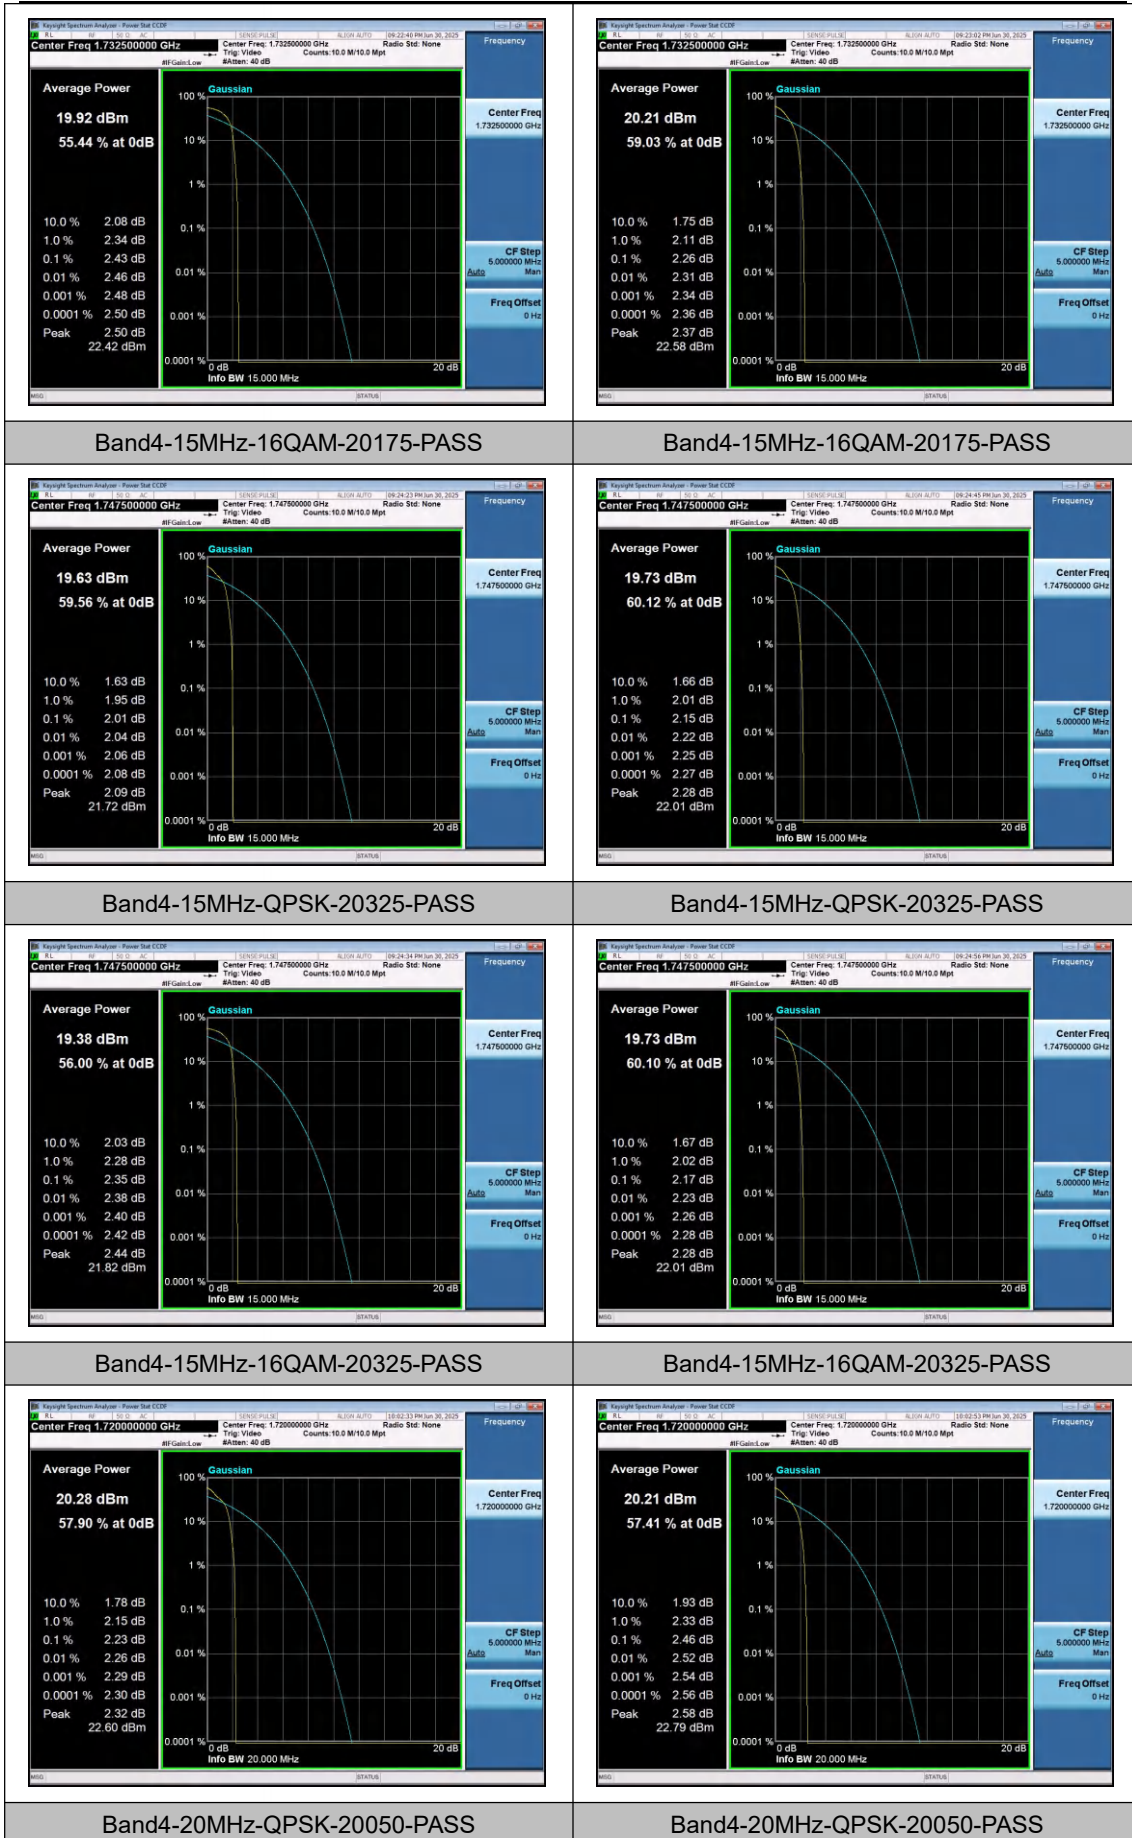

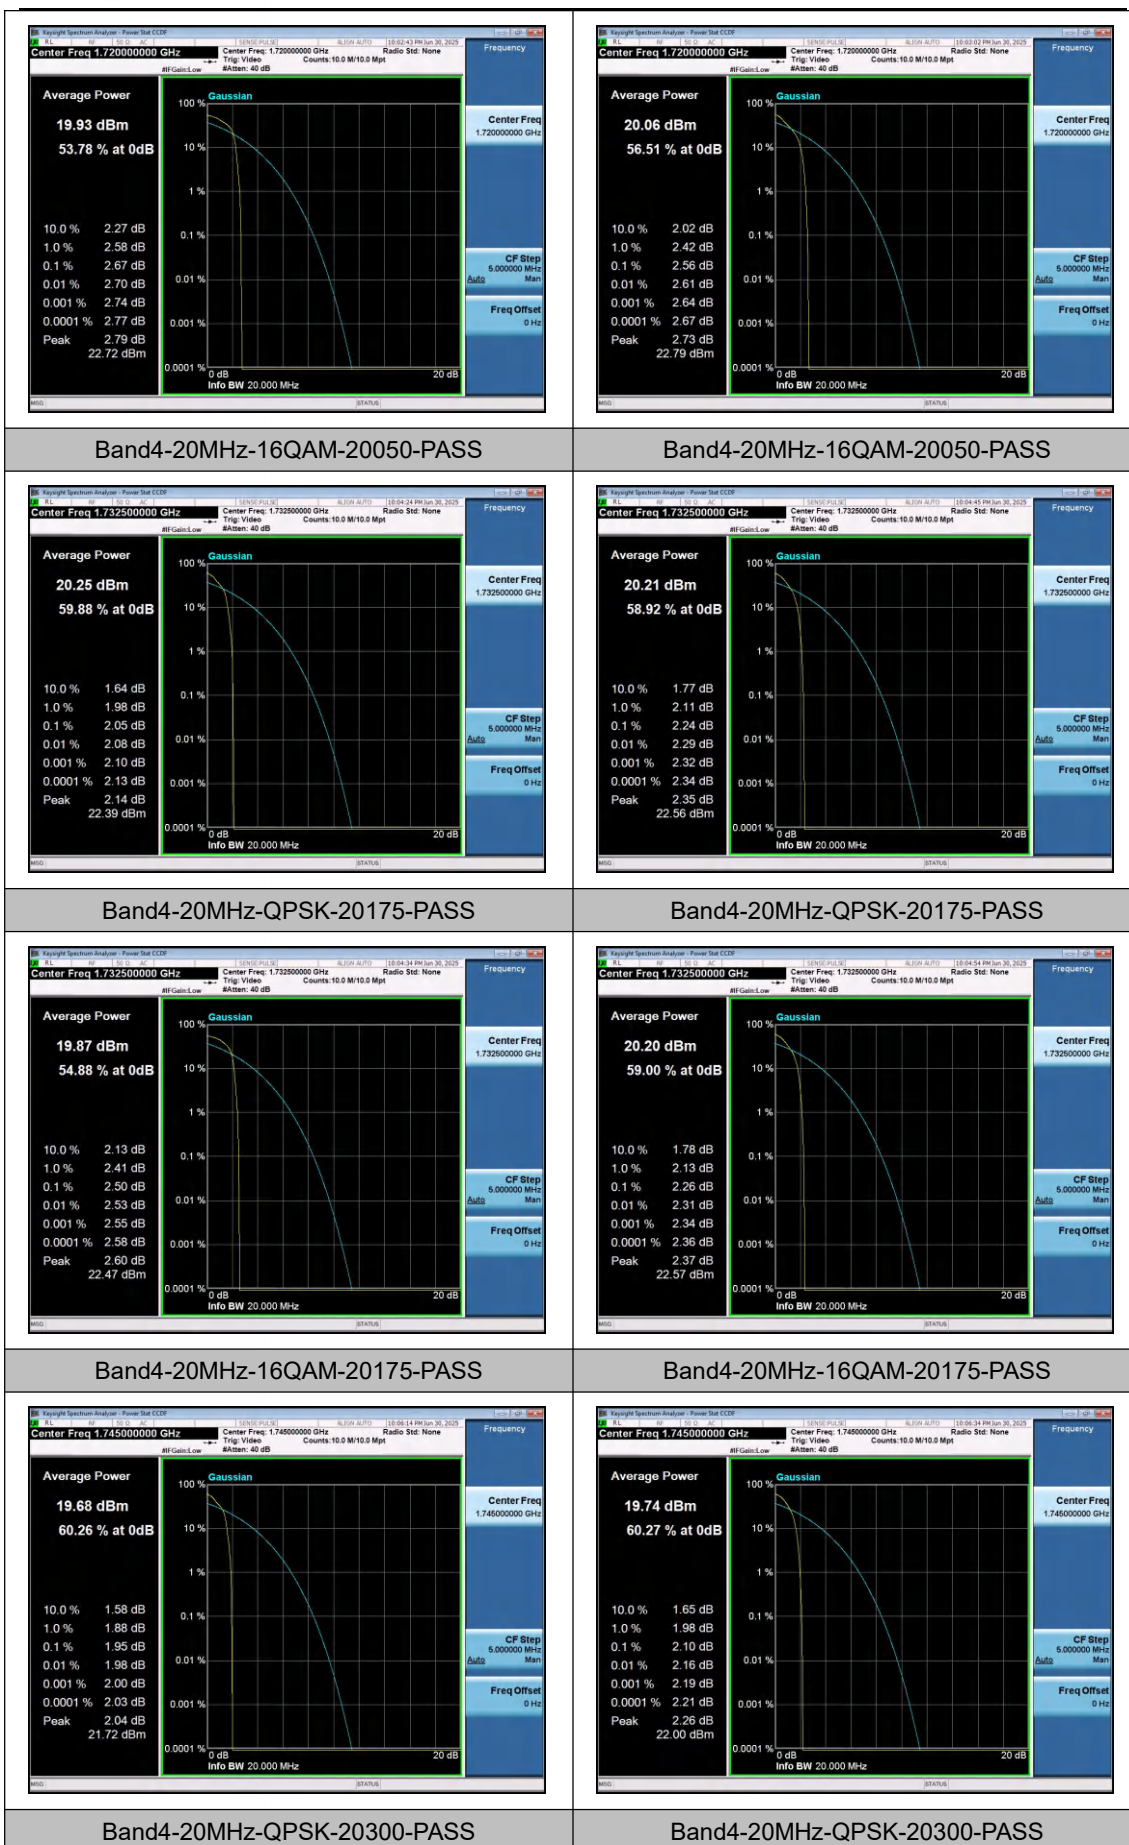

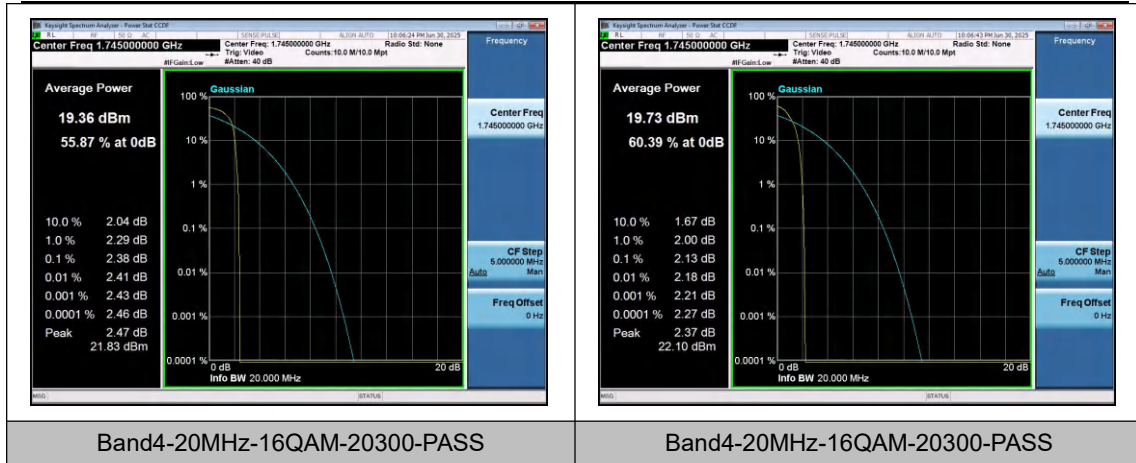

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: 26dB Bandwidth and Occupied Bandwidth for M1

Test Result


Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band4	1.4MHz	QPSK	19957	6	0	Low	1.0920	1.296	PASS
Band4	1.4MHz	16QAM	19957	6	0	Low	1.0922	1.299	PASS
Band4	1.4MHz	QPSK	20175	6	0	Low	1.0955	1.305	PASS
Band4	1.4MHz	16QAM	20175	6	0	Low	1.0964	1.299	PASS
Band4	1.4MHz	QPSK	20393	6	0	High	1.0979	1.303	PASS
Band4	1.4MHz	16QAM	20393	6	0	High	1.0967	1.305	PASS
Band4	3MHz	QPSK	19965	6	0	Low	1.1253	1.354	PASS
Band4	3MHz	16QAM	19965	6	0	Low	1.1209	1.352	PASS
Band4	3MHz	QPSK	20175	6	0	Low	1.1244	1.366	PASS
Band4	3MHz	16QAM	20175	6	0	Low	1.1129	1.370	PASS
Band4	3MHz	QPSK	20385	6	0	High	1.1213	1.352	PASS
Band4	3MHz	16QAM	20385	6	0	High	1.1167	1.357	PASS
Band4	5MHz	QPSK	19975	6	0	Low	1.2198	2.064	PASS
Band4	5MHz	16QAM	19975	6	0	Low	1.2165	2.054	PASS
Band4	5MHz	QPSK	20175	6	0	Low	1.2242	2.209	PASS
Band4	5MHz	16QAM	20175	6	0	Low	1.2288	2.206	PASS
Band4	5MHz	QPSK	20375	6	0	High	1.2249	2.179	PASS
Band4	5MHz	16QAM	20375	6	0	High	1.2266	2.197	PASS
Band4	10MHz	QPSK	20000	6	0	Low	1.4109	2.471	PASS
Band4	10MHz	16QAM	20000	6	0	Low	1.4045	2.529	PASS
Band4	10MHz	QPSK	20175	6	0	Low	1.4246	2.666	PASS
Band4	10MHz	16QAM	20175	6	0	Low	1.4115	2.636	PASS
Band4	10MHz	QPSK	20350	6	0	High	1.4441	2.807	PASS
Band4	10MHz	16QAM	20350	6	0	High	1.4087	2.735	PASS
Band4	15MHz	QPSK	20025	6	0	Low	1.8285	3.117	PASS
Band4	15MHz	16QAM	20025	6	0	Low	1.7923	3.112	PASS
Band4	15MHz	QPSK	20175	6	0	Low	1.9062	3.130	PASS
Band4	15MHz	16QAM	20175	6	0	Low	1.9329	3.105	PASS
Band4	15MHz	QPSK	20325	6	0	High	1.9646	3.137	PASS
Band4	15MHz	16QAM	20325	6	0	High	1.9395	3.124	PASS
Band4	20MHz	QPSK	20050	6	0	Low	2.5943	4.974	PASS
Band4	20MHz	16QAM	20050	6	0	Low	2.7176	5.156	PASS
Band4	20MHz	QPSK	20175	6	0	Low	2.9219	5.344	PASS
Band4	20MHz	16QAM	20175	6	0	Low	2.7100	5.286	PASS
Band4	20MHz	QPSK	20300	6	0	High	2.6687	5.389	PASS
Band4	20MHz	16QAM	20300	6	0	High	2.9924	5.327	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

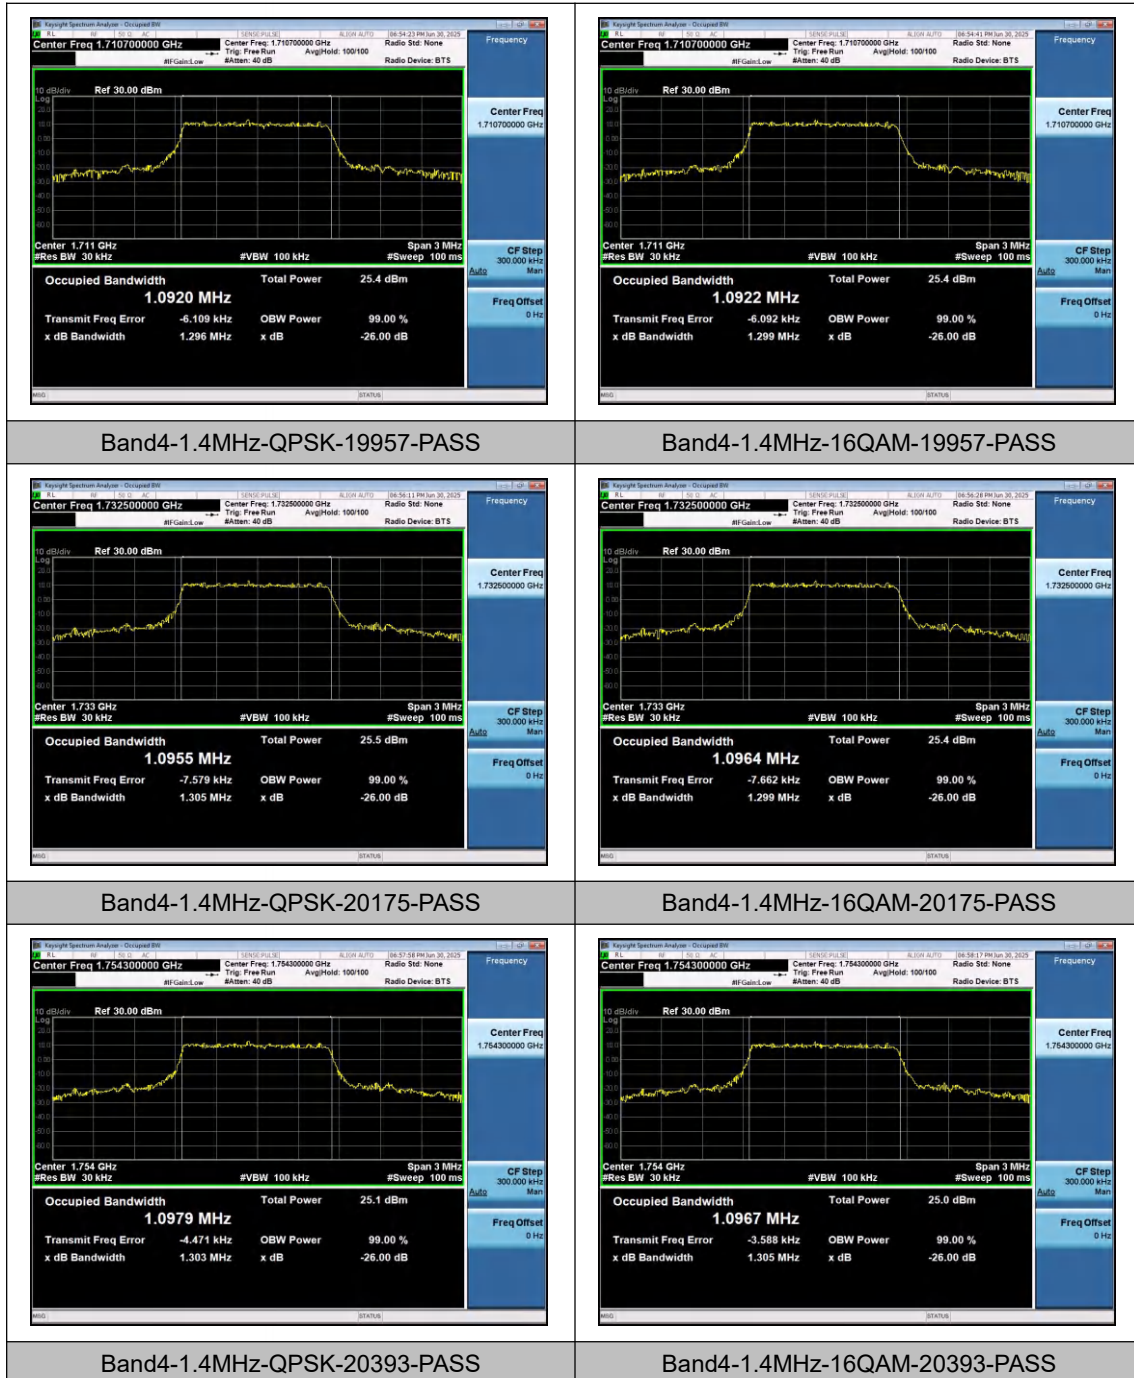

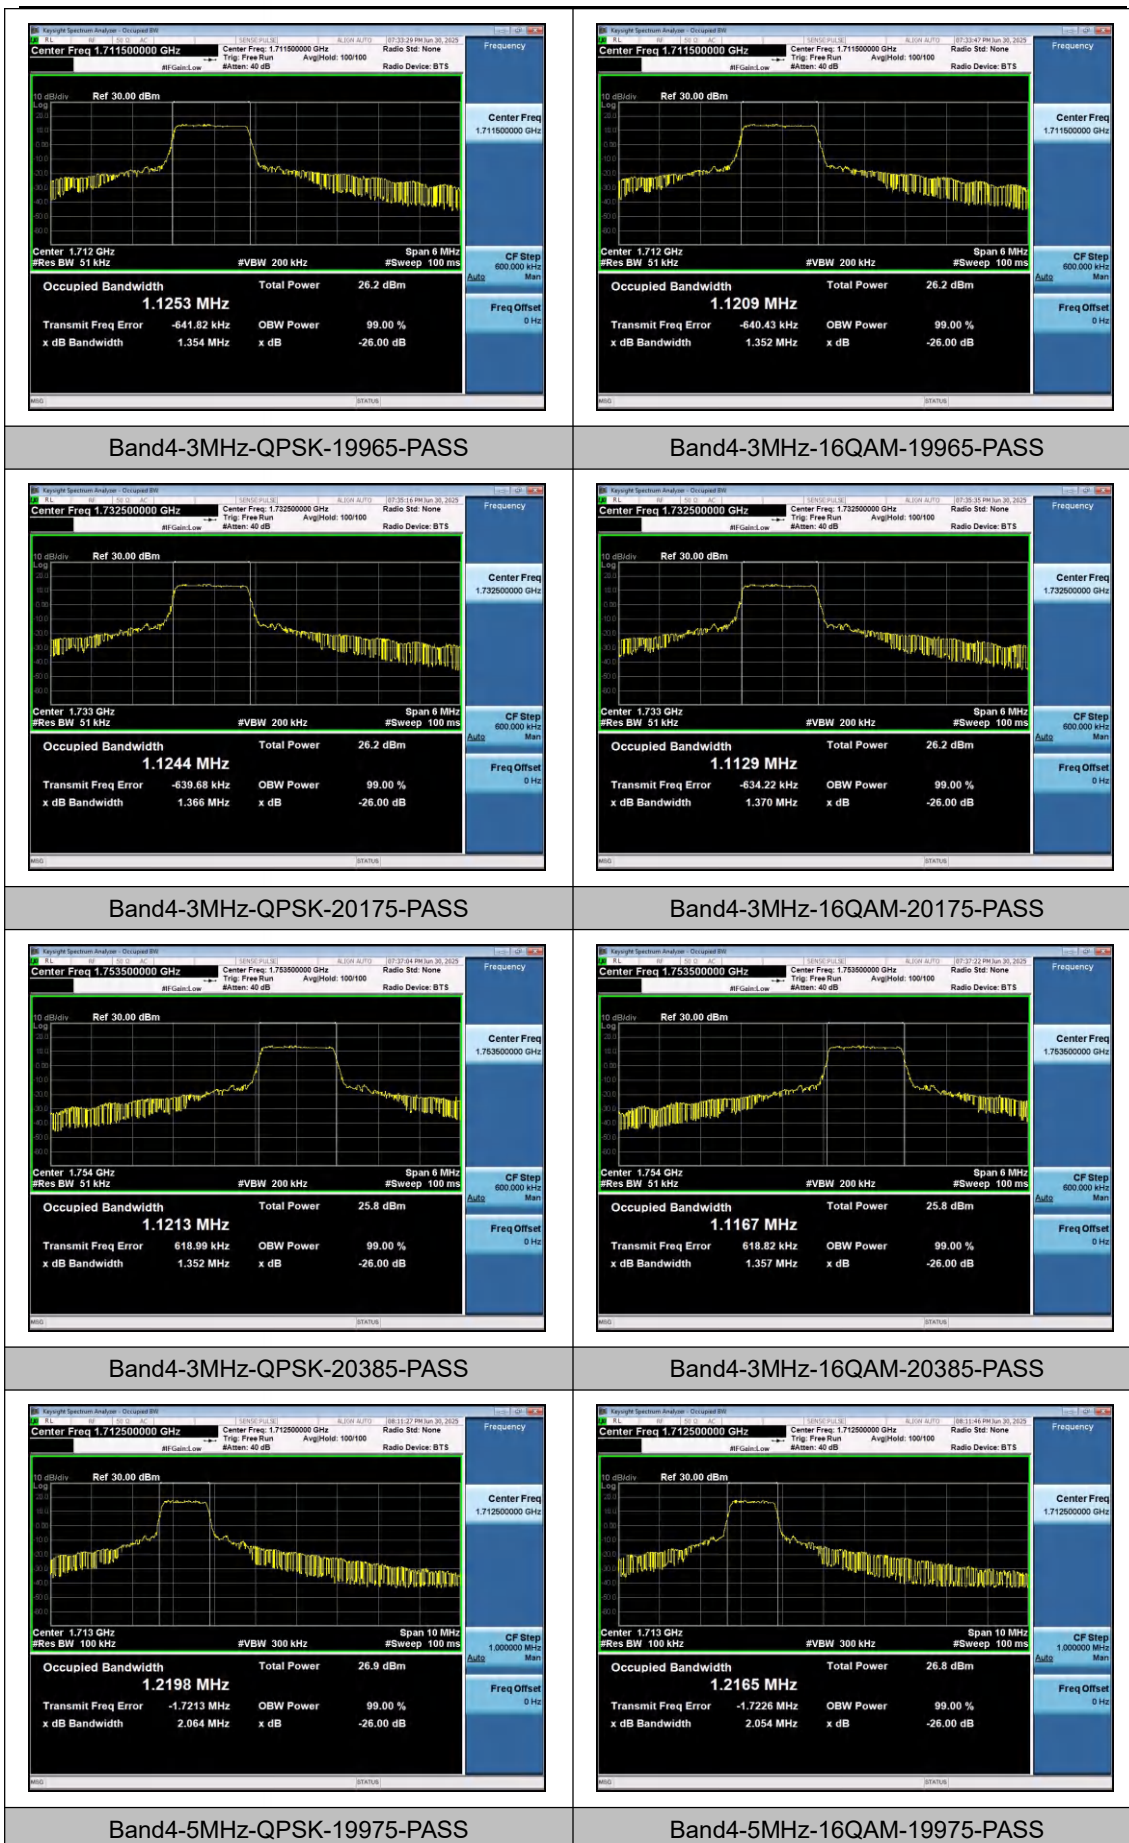

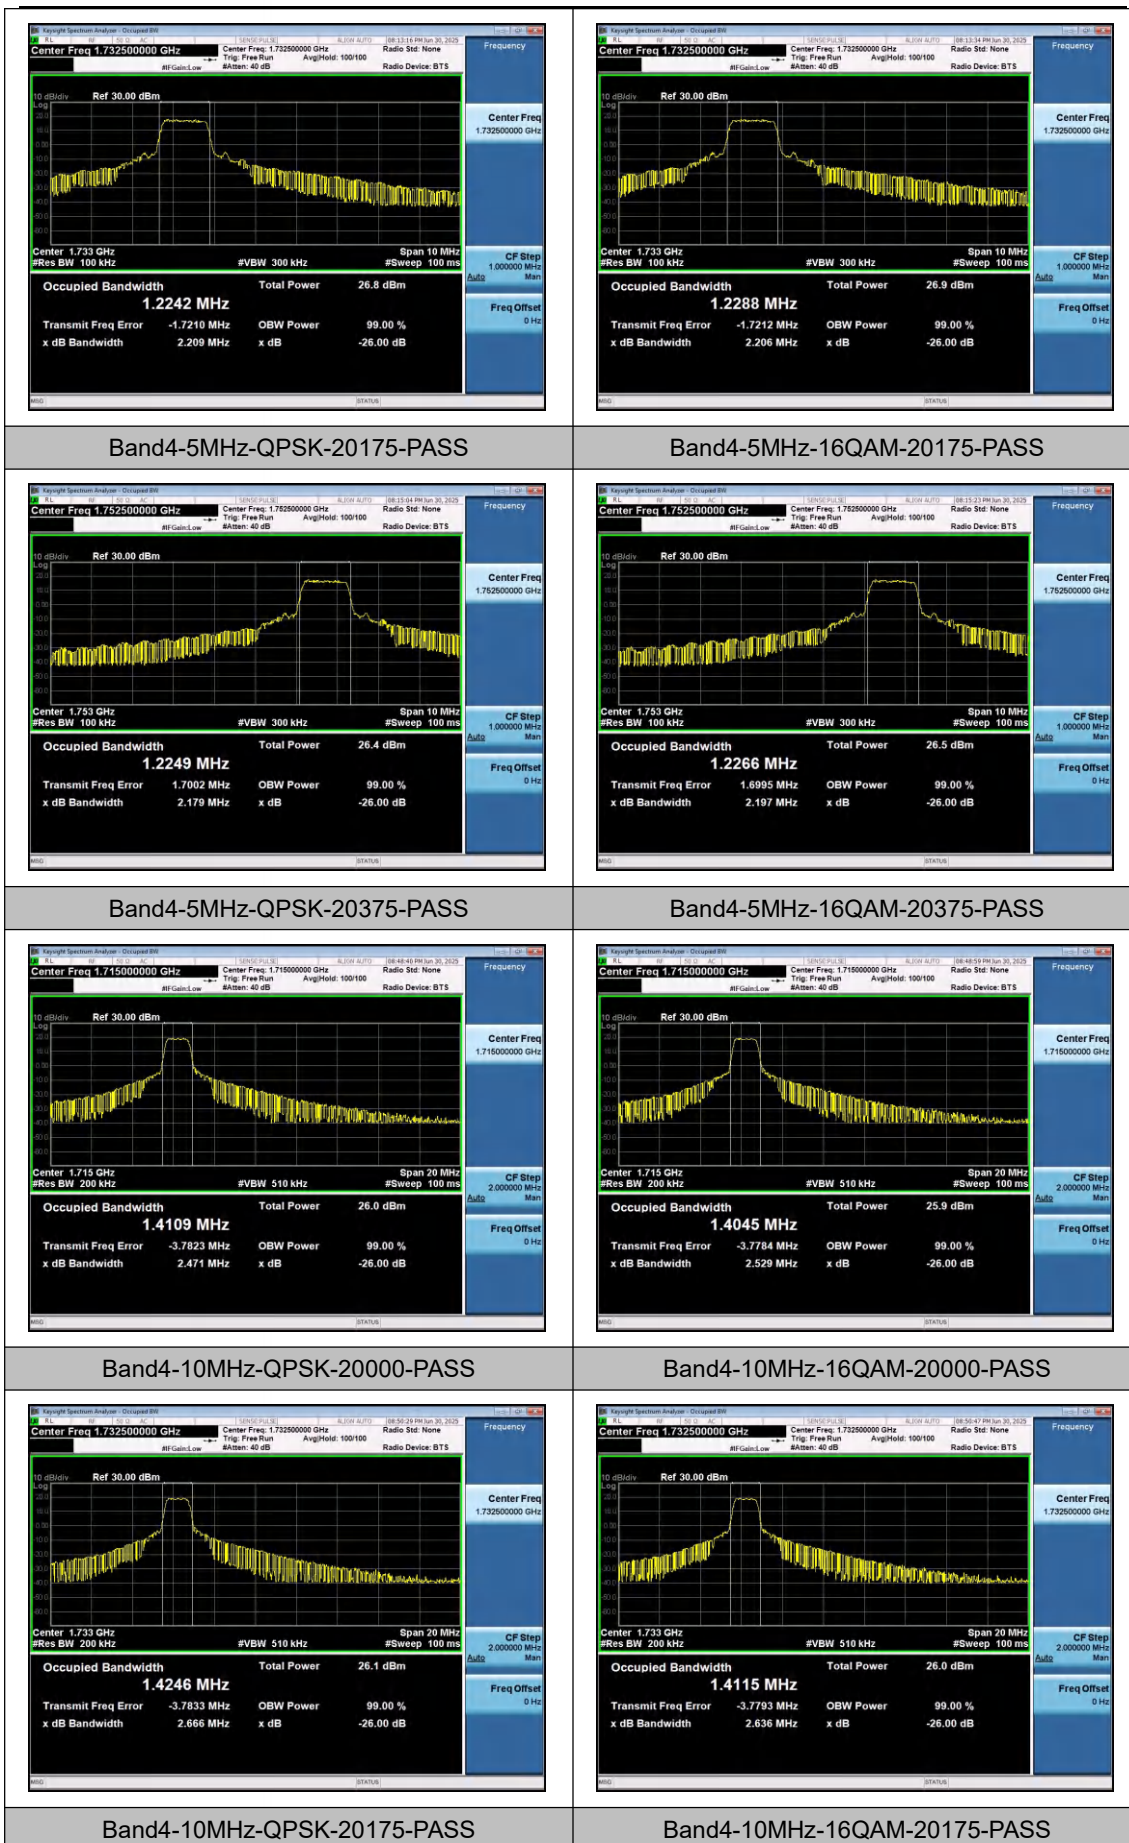

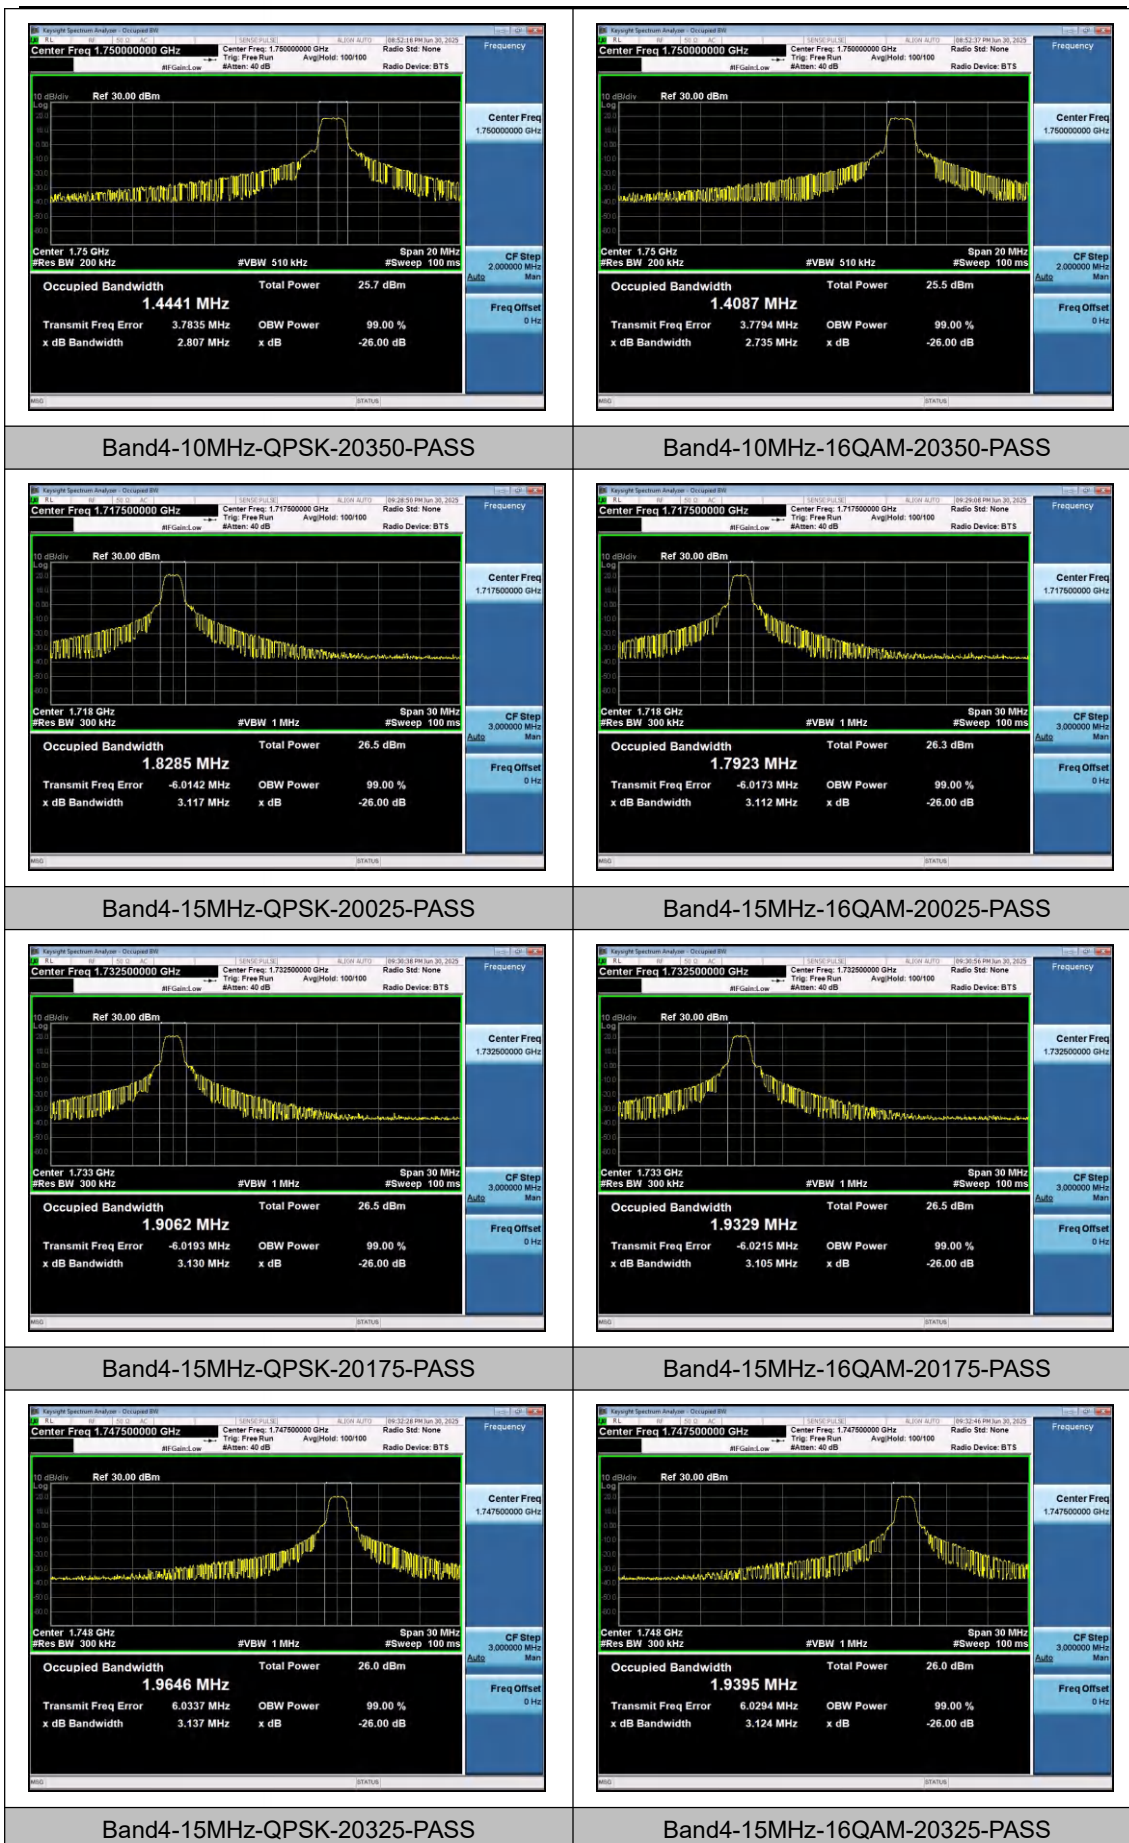

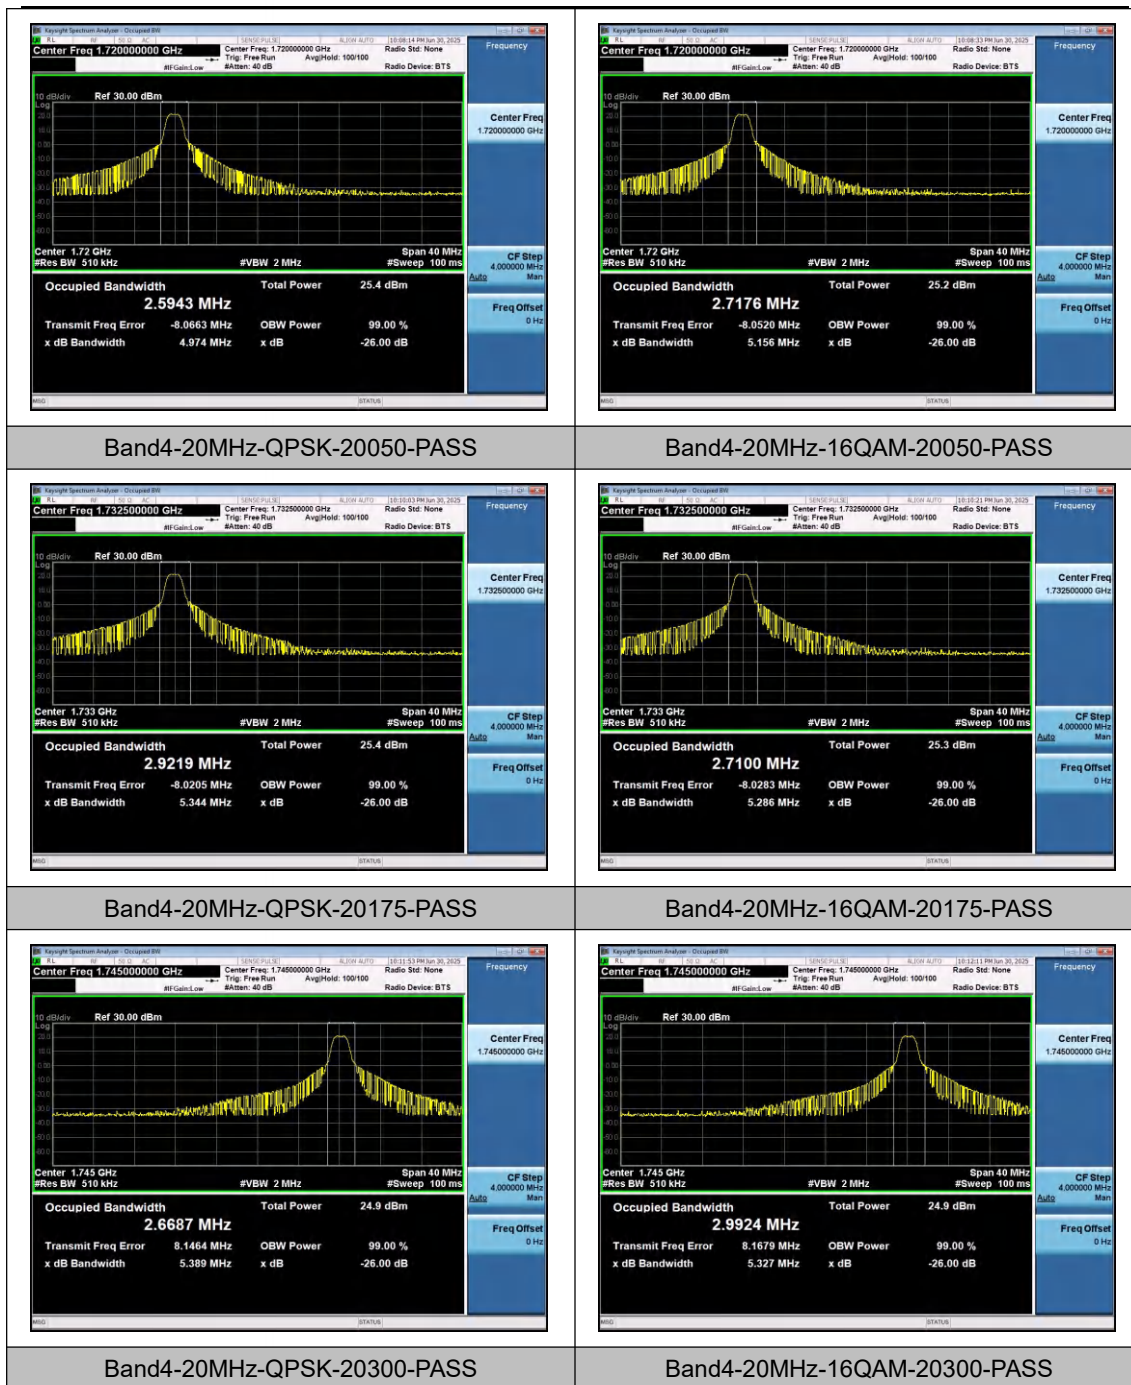

Appendix D: Band Edge for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Result(dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1	0	Low	-24.70	PASS
Band4	1.4MHz	QPSK	19957	6	0	Low	-34.65	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	-37.88	PASS
Band4	1.4MHz	16QAM	19957	6	0	Low	-43.95	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	-60.84	PASS
Band4	1.4MHz	QPSK	20393	6	0	High	-47.10	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	-62.31	PASS
Band4	1.4MHz	16QAM	20393	6	0	High	-32.78	PASS
Band4	3MHz	QPSK	19965	1	0	Low	-48.44	PASS
Band4	3MHz	QPSK	19965	6	0	Low	-50.76	PASS
Band4	3MHz	16QAM	19965	1	0	Low	-48.34	PASS
Band4	3MHz	16QAM	19965	6	0	Low	-40.15	PASS
Band4	3MHz	QPSK	20385	1	5	High	-54.56	PASS
Band4	3MHz	QPSK	20385	6	0	High	-47.41	PASS
Band4	3MHz	16QAM	20385	1	5	High	-56.00	PASS
Band4	3MHz	16QAM	20385	6	0	High	-42.24	PASS
Band4	5MHz	QPSK	19975	1	0	Low	-39.61	PASS
Band4	5MHz	QPSK	19975	6	0	Low	-37.66	PASS
Band4	5MHz	16QAM	19975	1	0	Low	-38.73	PASS
Band4	5MHz	16QAM	19975	6	0	Low	-44.25	PASS
Band4	5MHz	QPSK	20375	1	5	High	-55.85	PASS
Band4	5MHz	QPSK	20375	6	0	High	-30.70	PASS
Band4	5MHz	16QAM	20375	1	5	High	-54.64	PASS
Band4	5MHz	16QAM	20375	6	0	High	-38.42	PASS
Band4	10MHz	QPSK	20000	1	0	Low	-51.35	PASS
Band4	10MHz	QPSK	20000	6	0	Low	-43.90	PASS
Band4	10MHz	16QAM	20000	1	0	Low	-50.24	PASS
Band4	10MHz	16QAM	20000	6	0	Low	-42.36	PASS
Band4	10MHz	QPSK	20350	1	5	High	-52.63	PASS
Band4	10MHz	QPSK	20350	6	0	High	-32.30	PASS
Band4	10MHz	16QAM	20350	1	5	High	-54.14	PASS
Band4	10MHz	16QAM	20350	6	0	High	-34.51	PASS
Band4	15MHz	QPSK	20025	1	0	Low	-48.11	PASS
Band4	15MHz	QPSK	20025	6	0	Low	-34.15	PASS
Band4	15MHz	16QAM	20025	1	0	Low	-53.71	PASS
Band4	15MHz	16QAM	20025	6	0	Low	-31.14	PASS
Band4	15MHz	QPSK	20325	6	0	High	-44.80	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band4	15MHz	QPSK	20325	1	5	High	-54.59	PASS
Band4	15MHz	16QAM	20325	1	5	High	-55.11	PASS
Band4	15MHz	16QAM	20325	6	0	High	-32.72	PASS
Band4	20MHz	QPSK	20050	1	0	Low	-53.16	PASS
Band4	20MHz	QPSK	20050	6	0	Low	-37.55	PASS
Band4	20MHz	16QAM	20050	1	0	Low	-54.33	PASS
Band4	20MHz	16QAM	20050	6	0	Low	-43.64	PASS
Band4	20MHz	QPSK	20300	1	5	High	-53.72	PASS
Band4	20MHz	QPSK	20300	6	0	High	-38.93	PASS
Band4	20MHz	16QAM	20300	1	5	High	-53.96	PASS
Band4	20MHz	16QAM	20300	6	0	High	-43.71	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

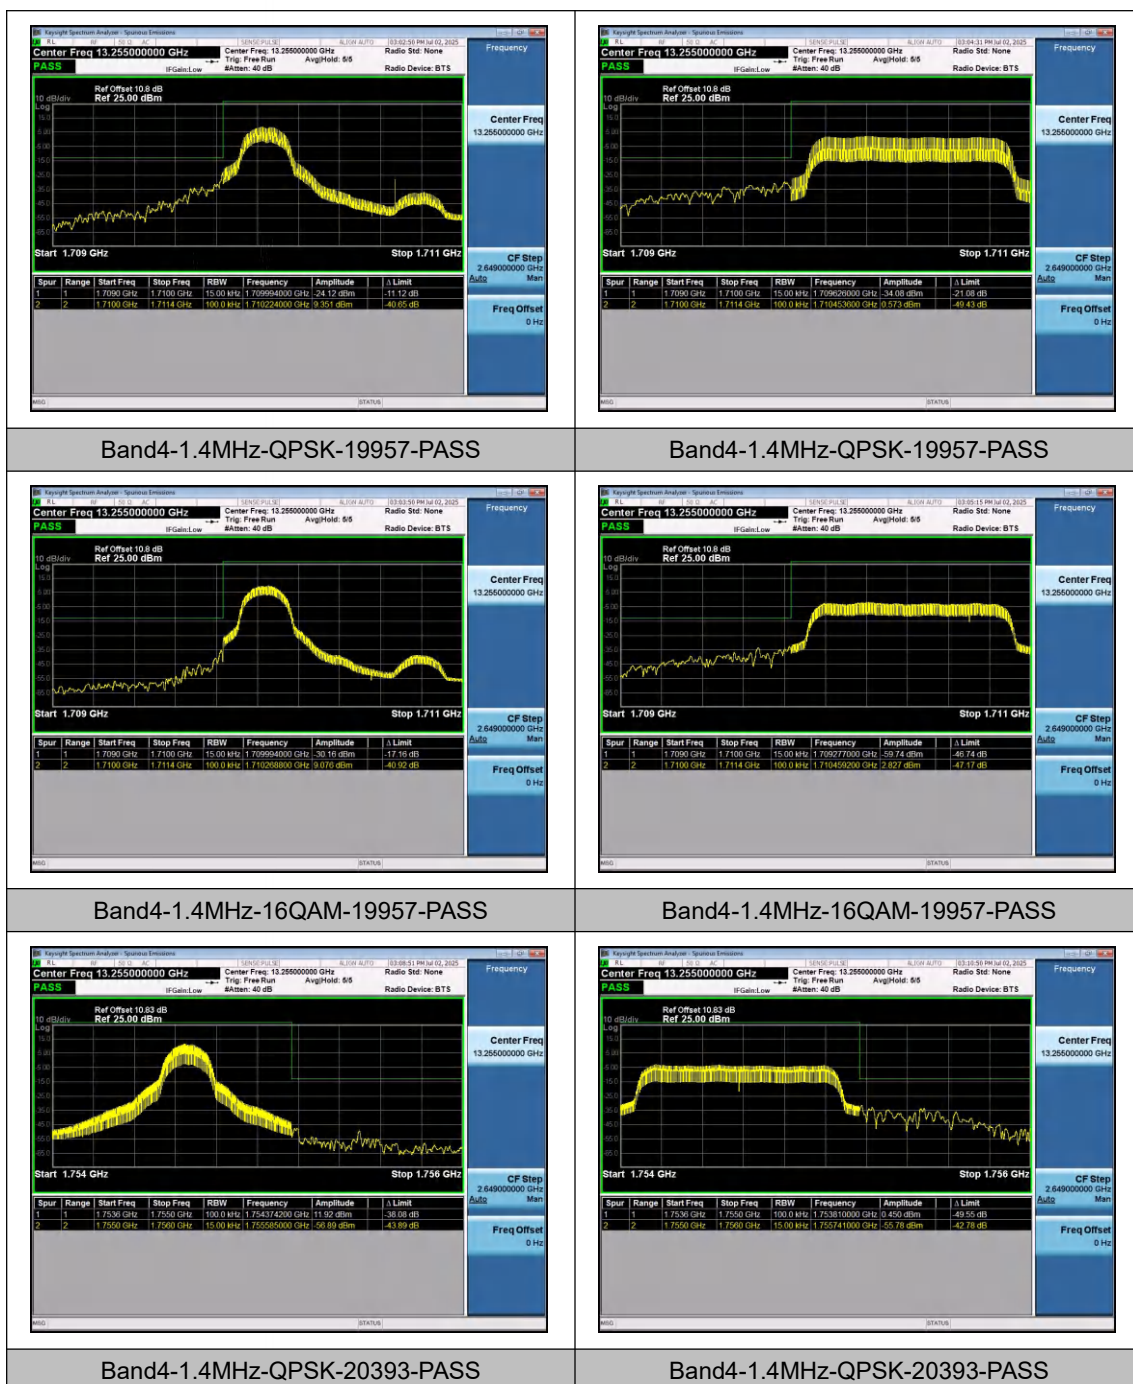


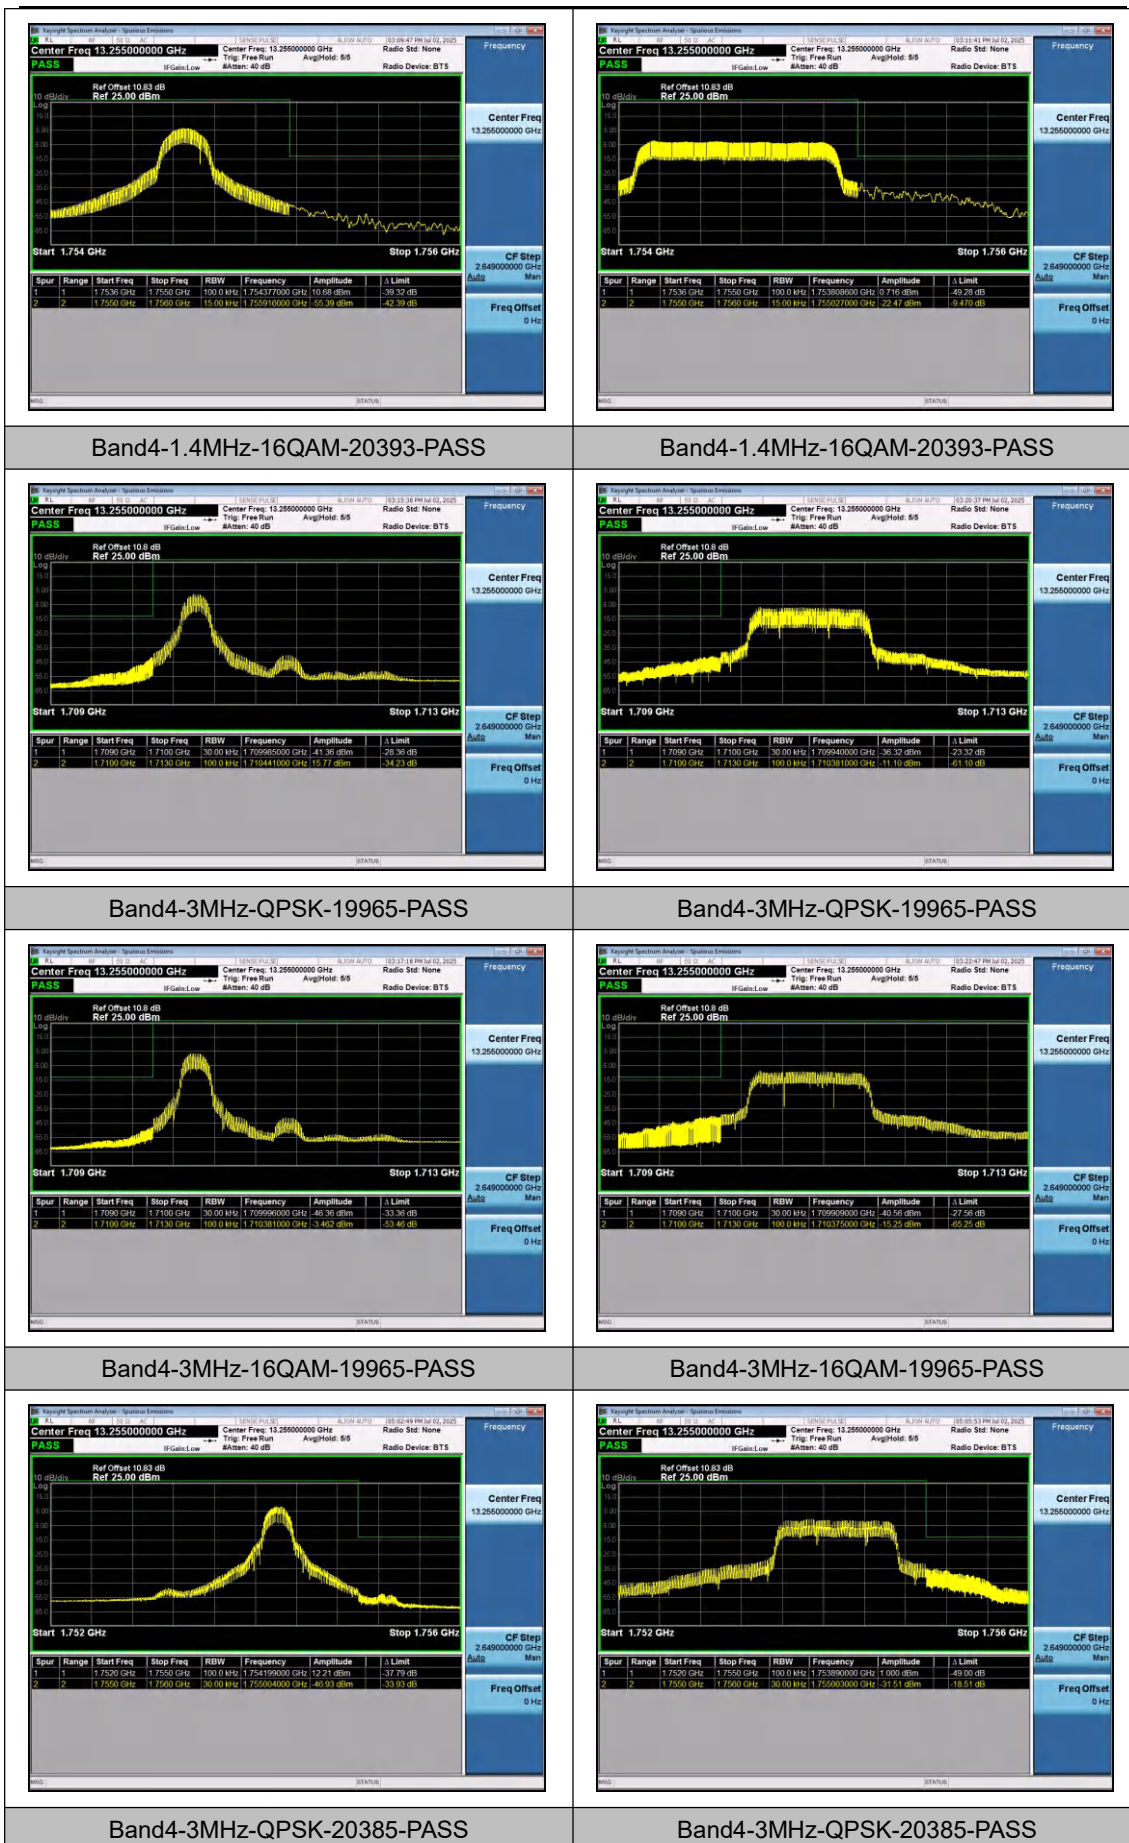


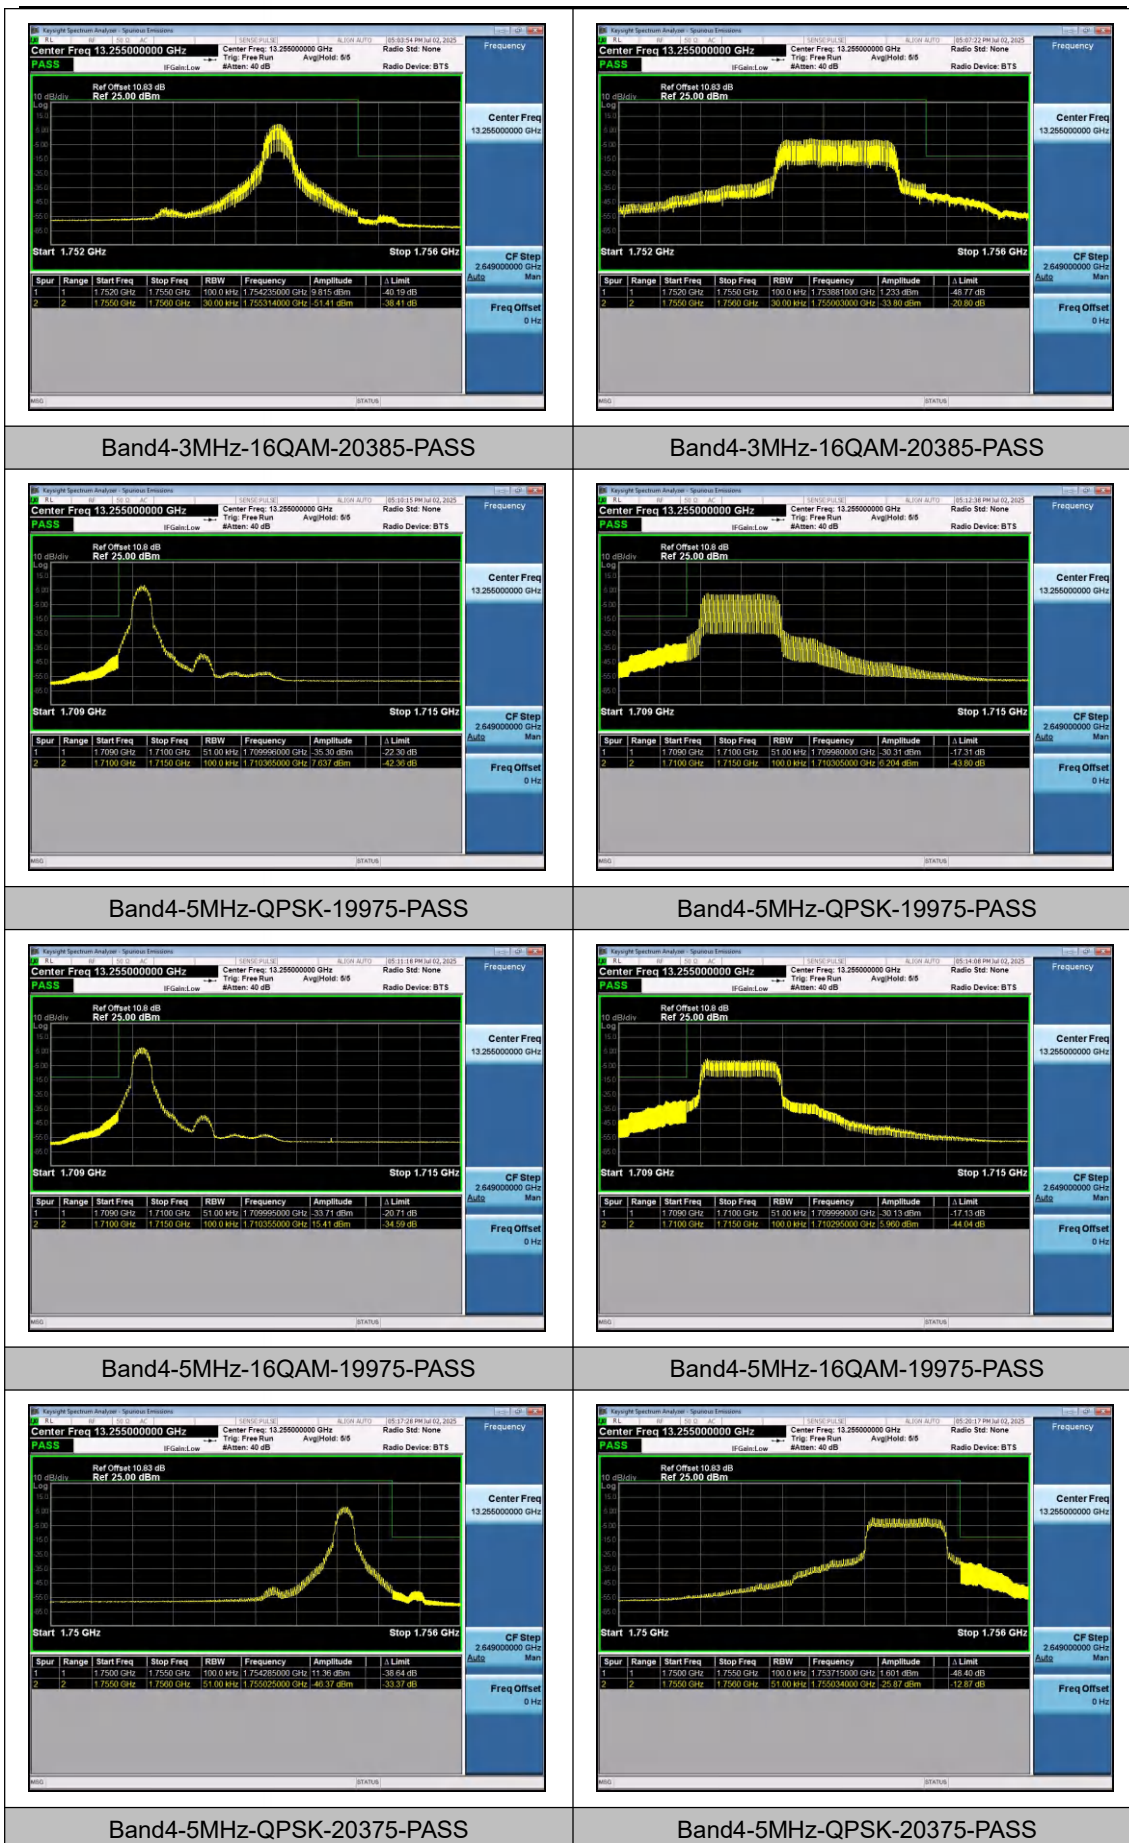

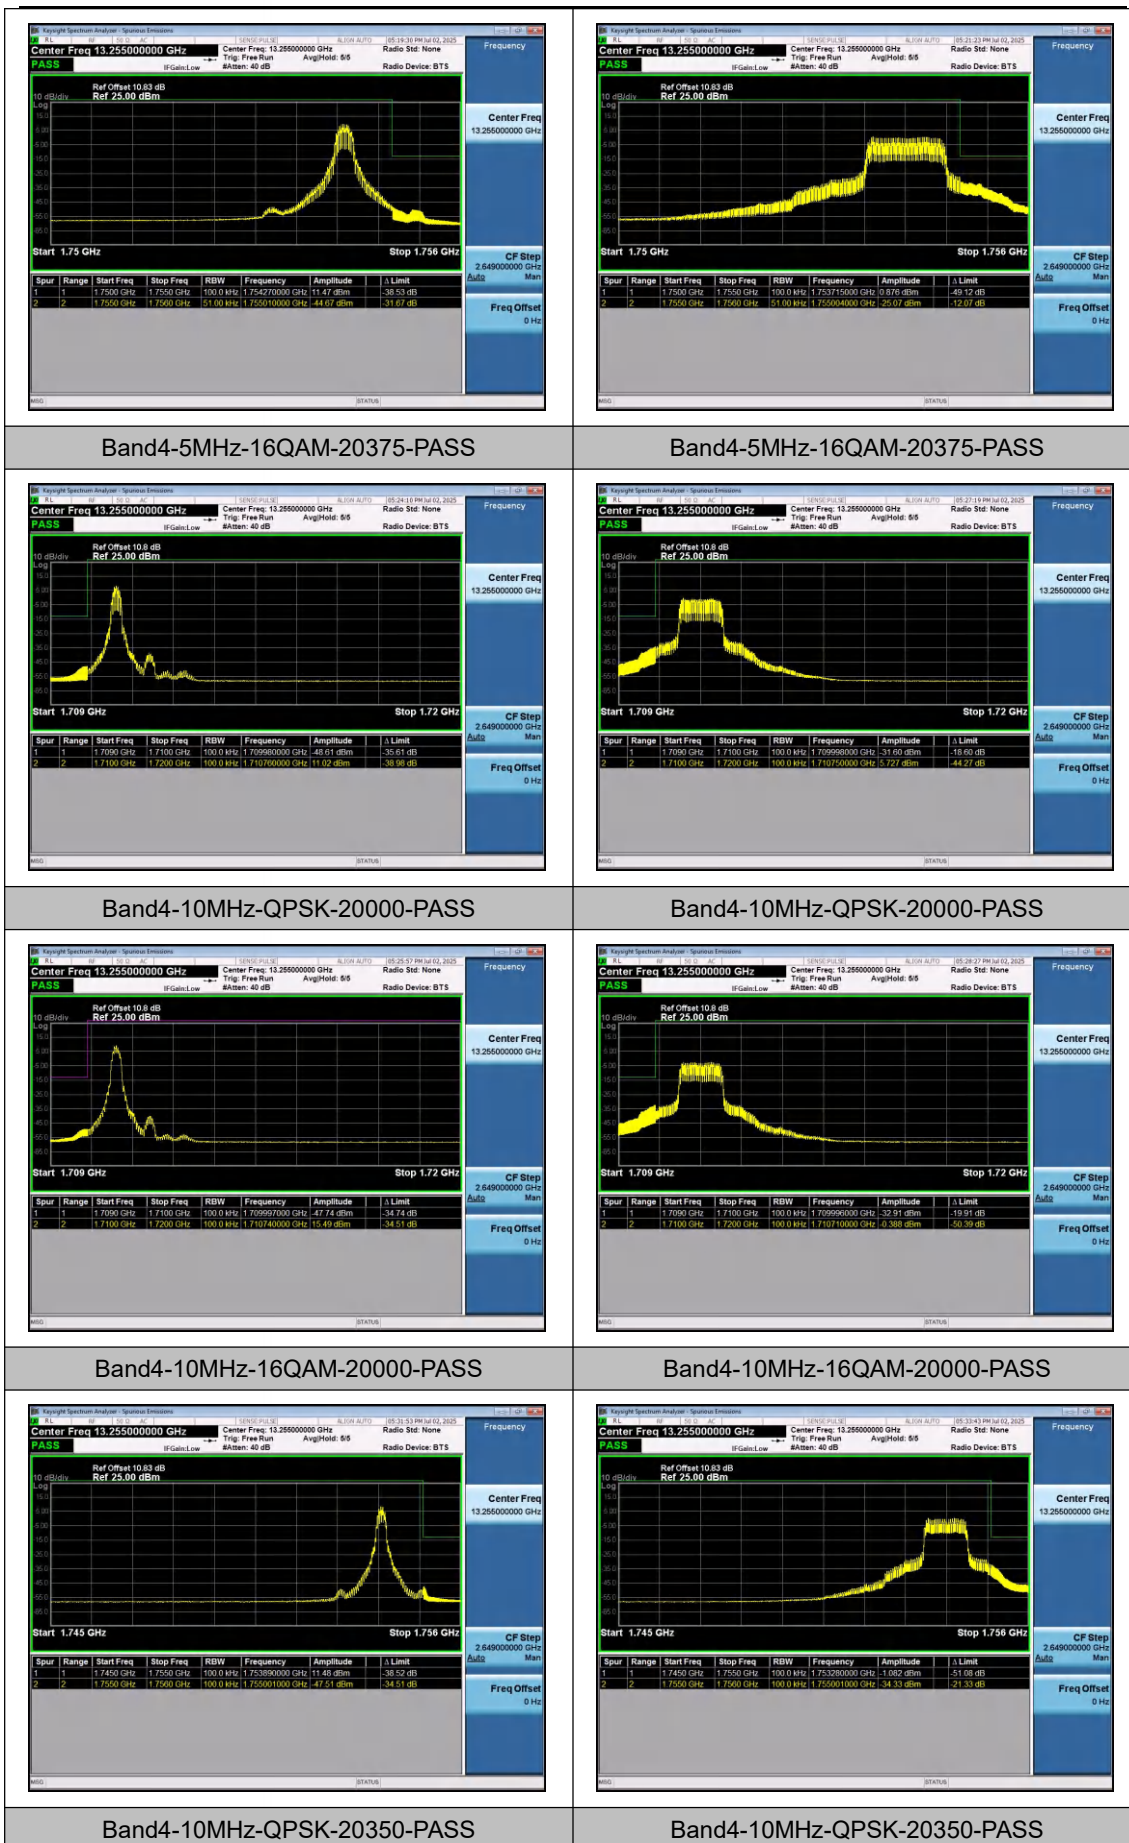

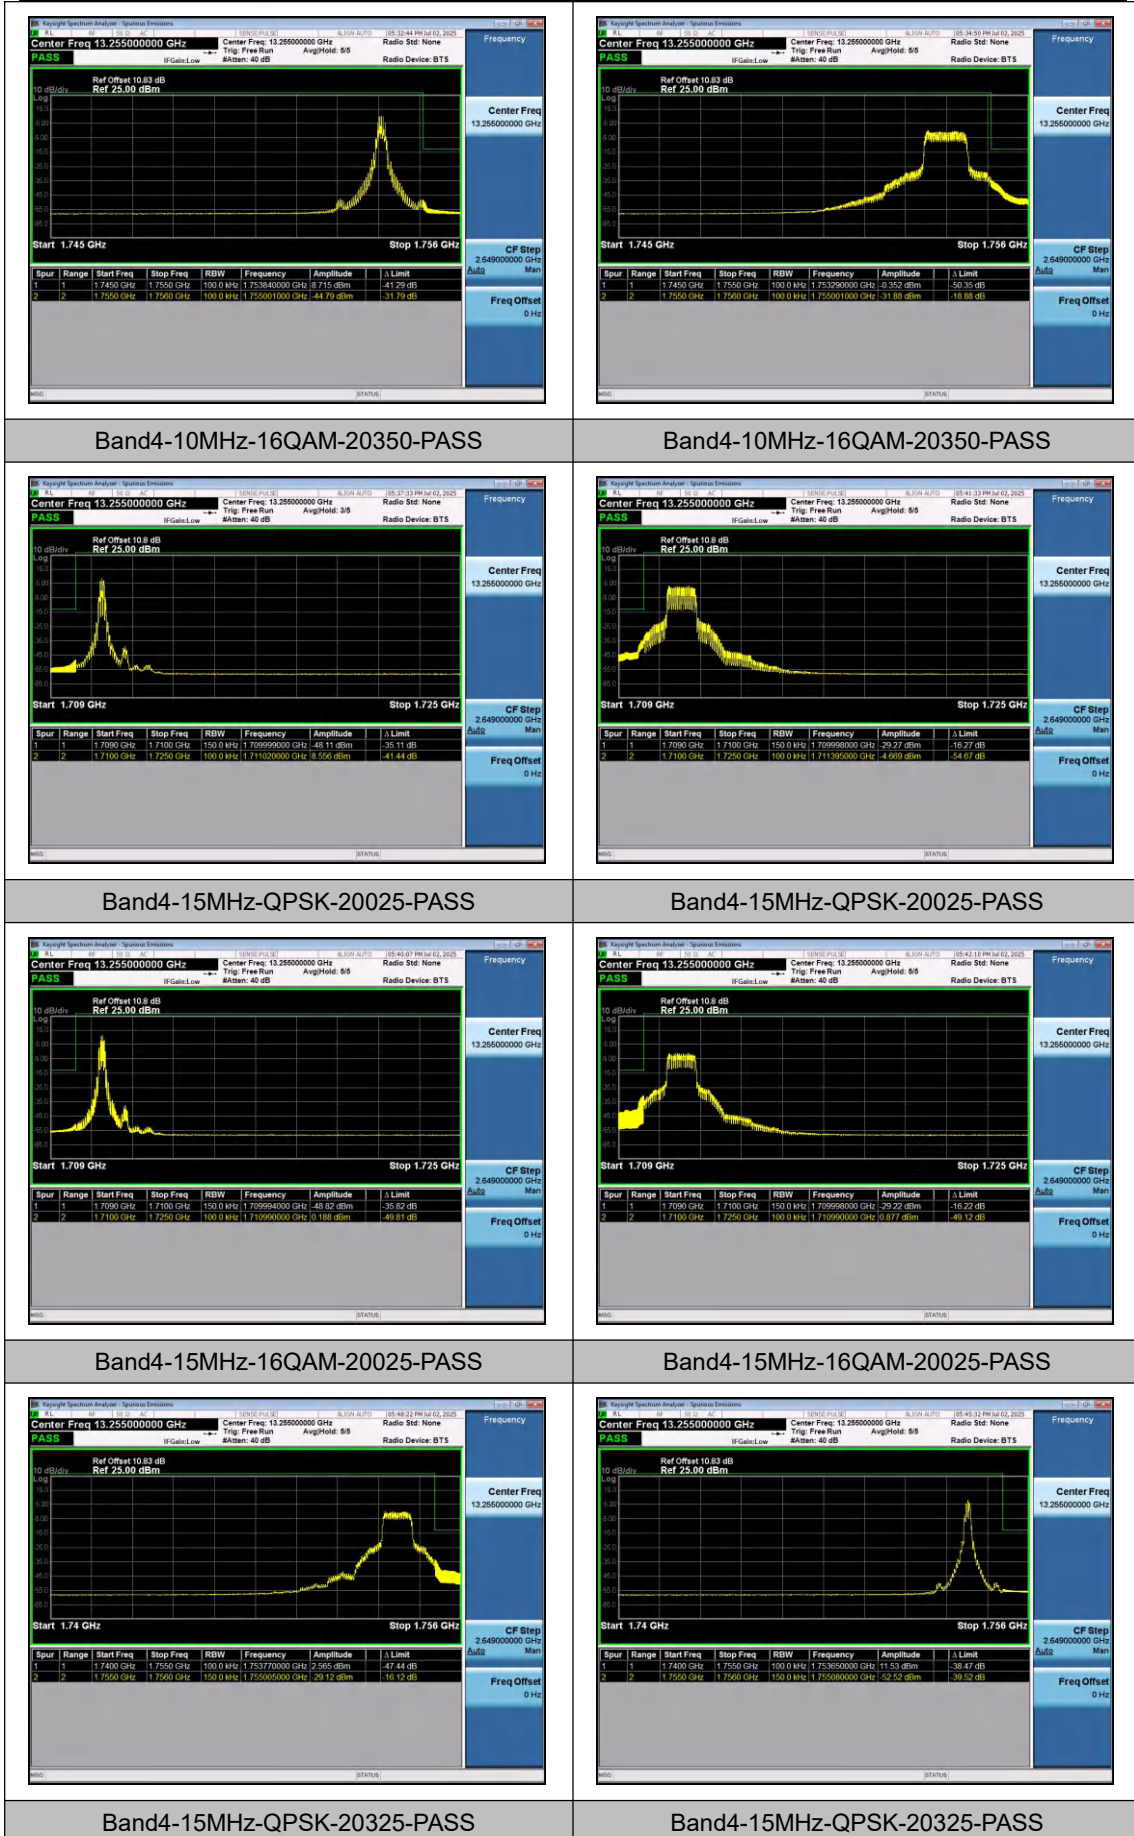

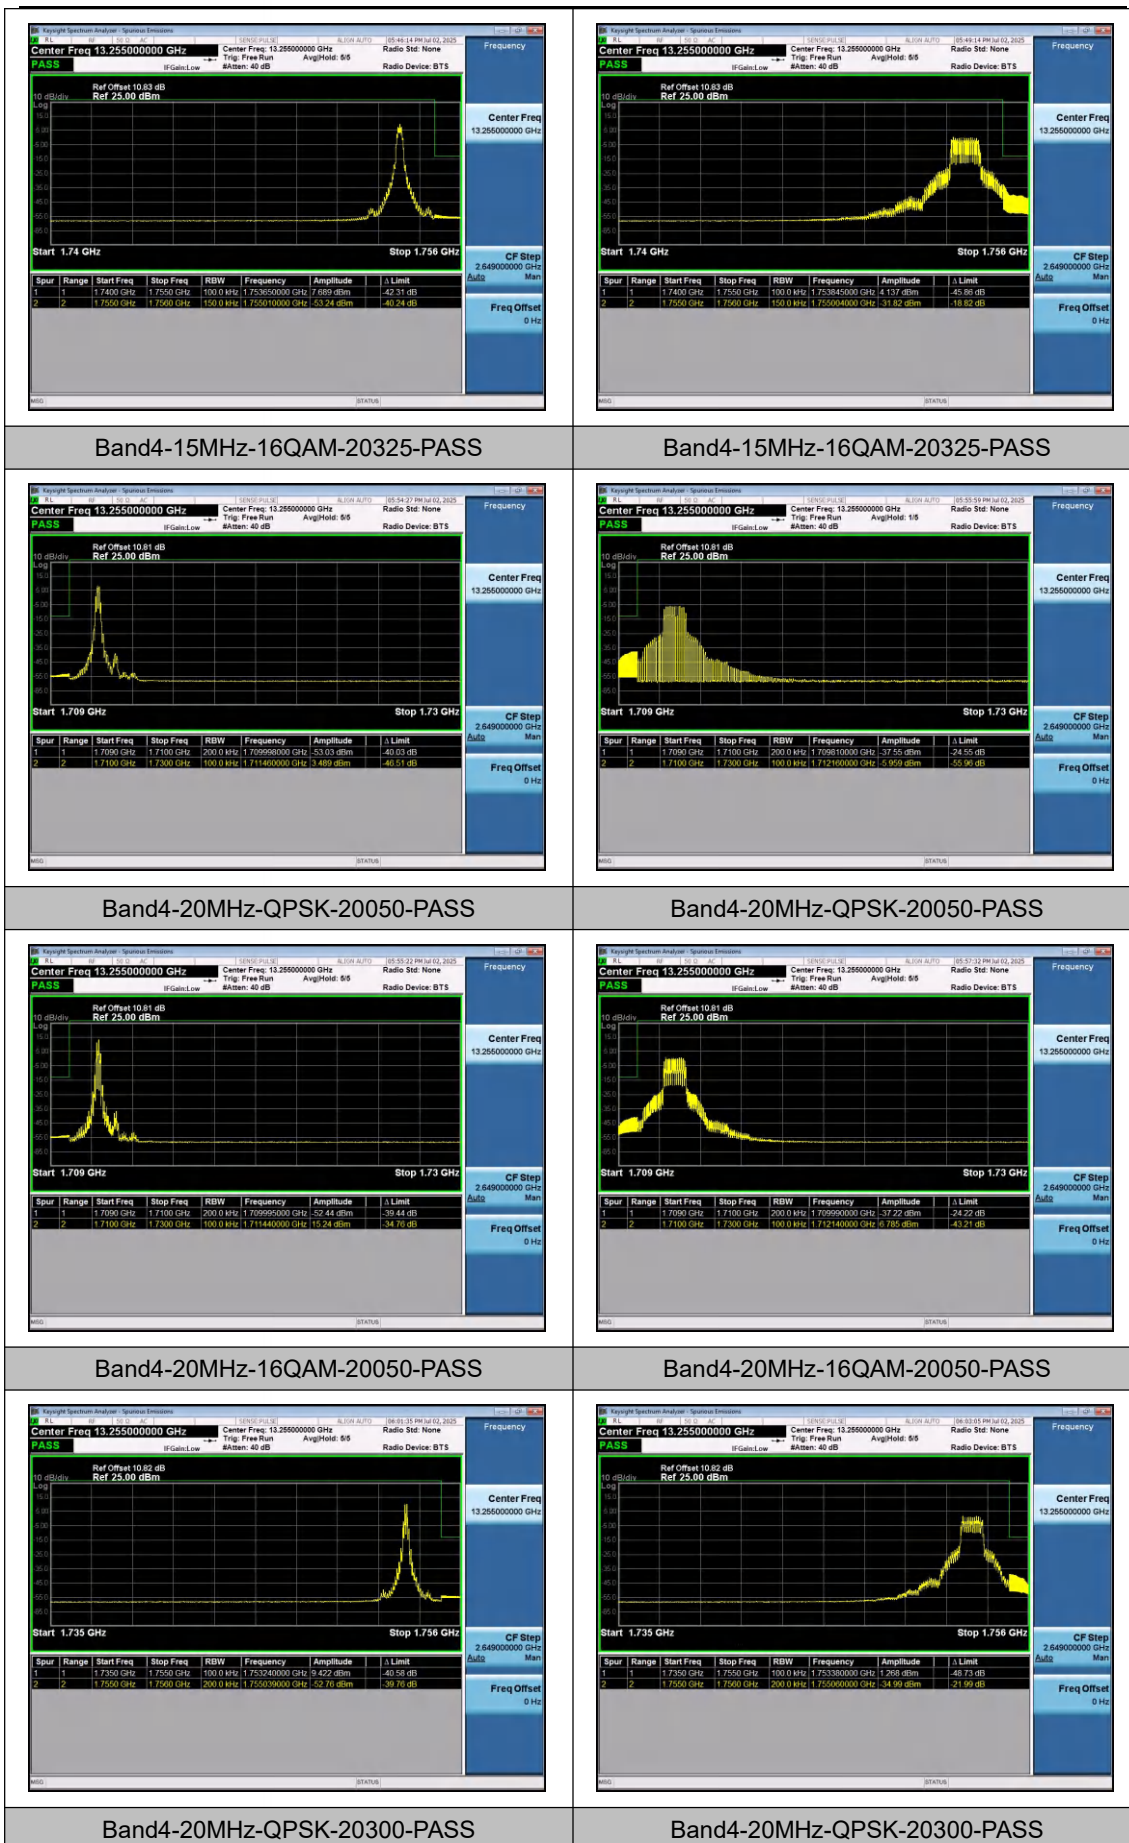

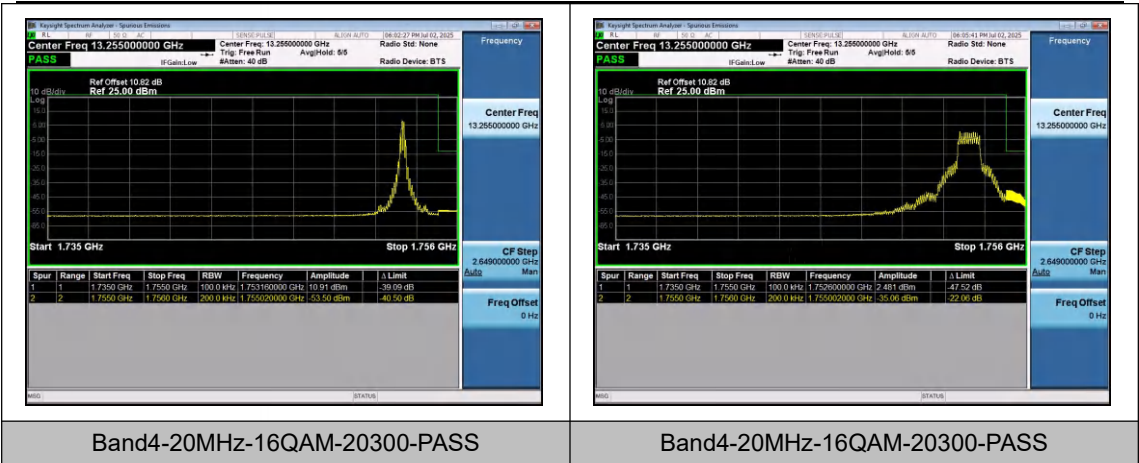

Appendix E: Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band4	1.4MHz	QPSK	19957	1	0	Low	0.009	0.15	-70.3	PASS
Band4	1.4MHz	QPSK	19957	1	0	Low	0.15	30	-73.61	PASS
Band4	1.4MHz	QPSK	19957	1	0	Low	30	1000	-51.05	PASS
Band4	1.4MHz	QPSK	19957	1	0	Low	1000	20000	-41.42	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	0.009	0.15	-71.81	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	0.15	30	-76.59	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	30	1000	-51.06	PASS
Band4	1.4MHz	16QAM	19957	1	0	Low	1000	20000	-41.13	PASS
Band4	1.4MHz	QPSK	20175	1	0	Low	0.009	0.15	-73.29	PASS
Band4	1.4MHz	QPSK	20175	1	0	Low	0.15	30	-74.47	PASS
Band4	1.4MHz	QPSK	20175	1	0	Low	30	1000	-51.12	PASS
Band4	1.4MHz	QPSK	20175	1	0	Low	1000	20000	-41.37	PASS
Band4	1.4MHz	16QAM	20175	1	0	Low	0.009	0.15	-72.3	PASS
Band4	1.4MHz	16QAM	20175	1	0	Low	0.15	30	-75.27	PASS
Band4	1.4MHz	16QAM	20175	1	0	Low	30	1000	-51.13	PASS
Band4	1.4MHz	16QAM	20175	1	0	Low	1000	20000	-41.31	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	0.009	0.15	-73.1	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	0.15	30	-75.51	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	30	1000	-51.13	PASS
Band4	1.4MHz	QPSK	20393	1	5	High	1000	20000	-41.69	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	0.009	0.15	-71.77	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	0.15	30	-73.9	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	30	1000	-51.14	PASS
Band4	1.4MHz	16QAM	20393	1	5	High	1000	20000	-41.38	PASS
Band4	3MHz	QPSK	19965	1	0	Low	0.009	0.15	-72.89	PASS
Band4	3MHz	QPSK	19965	1	0	Low	0.15	30	-73.19	PASS
Band4	3MHz	QPSK	19965	1	0	Low	30	1000	-51.09	PASS
Band4	3MHz	QPSK	19965	1	0	Low	1000	20000	-40.13	PASS
Band4	3MHz	16QAM	19965	1	0	Low	0.009	0.15	-72.32	PASS
Band4	3MHz	16QAM	19965	1	0	Low	0.15	30	-73.14	PASS
Band4	3MHz	16QAM	19965	1	0	Low	30	1000	-51.06	PASS
Band4	3MHz	16QAM	19965	1	0	Low	1000	20000	-41.77	PASS
Band4	3MHz	QPSK	20175	1	0	Low	0.009	0.15	-74.21	PASS
Band4	3MHz	QPSK	20175	1	0	Low	0.15	30	-74.45	PASS
Band4	3MHz	QPSK	20175	1	0	Low	30	1000	-51.12	PASS
Band4	3MHz	QPSK	20175	1	0	Low	1000	20000	-39.81	PASS
Band4	3MHz	16QAM	20175	1	0	Low	0.009	0.15	-72.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band4	3MHz	16QAM	20175	1	0	Low	0.15	30	-70.15	PASS
Band4	3MHz	16QAM	20175	1	0	Low	30	1000	-51.05	PASS
Band4	3MHz	16QAM	20175	1	0	Low	1000	20000	-41.34	PASS
Band4	3MHz	QPSK	20385	1	5	High	0.009	0.15	-74.31	PASS
Band4	3MHz	QPSK	20385	1	5	High	0.15	30	-72.98	PASS
Band4	3MHz	QPSK	20385	1	5	High	30	1000	-51.06	PASS
Band4	3MHz	QPSK	20385	1	5	High	1000	20000	-41.26	PASS
Band4	3MHz	16QAM	20385	1	5	High	0.009	0.15	-72.44	PASS
Band4	3MHz	16QAM	20385	1	5	High	0.15	30	-72.59	PASS
Band4	3MHz	16QAM	20385	1	5	High	30	1000	-51.12	PASS
Band4	3MHz	16QAM	20385	1	5	High	1000	20000	-41.54	PASS
Band4	5MHz	QPSK	19975	1	0	Low	0.009	0.15	-72.97	PASS
Band4	5MHz	QPSK	19975	1	0	Low	0.15	30	-73.23	PASS
Band4	5MHz	QPSK	19975	1	0	Low	30	1000	-51.17	PASS
Band4	5MHz	QPSK	19975	1	0	Low	1000	20000	-41.25	PASS
Band4	5MHz	16QAM	19975	1	0	Low	0.009	0.15	-73.02	PASS
Band4	5MHz	16QAM	19975	1	0	Low	0.15	30	-75.69	PASS
Band4	5MHz	16QAM	19975	1	0	Low	30	1000	-51.15	PASS
Band4	5MHz	16QAM	19975	1	0	Low	1000	20000	-41.4	PASS
Band4	5MHz	QPSK	20175	1	0	Low	0.009	0.15	-73.3	PASS
Band4	5MHz	QPSK	20175	1	0	Low	0.15	30	-73.14	PASS
Band4	5MHz	QPSK	20175	1	0	Low	30	1000	-51.07	PASS
Band4	5MHz	QPSK	20175	1	0	Low	1000	20000	-41.57	PASS
Band4	5MHz	16QAM	20175	1	0	Low	0.009	0.15	-72.77	PASS
Band4	5MHz	16QAM	20175	1	0	Low	0.15	30	-73.74	PASS
Band4	5MHz	16QAM	20175	1	0	Low	30	1000	-51.15	PASS
Band4	5MHz	16QAM	20175	1	0	Low	1000	20000	-41.08	PASS
Band4	5MHz	QPSK	20375	1	5	High	0.009	0.15	-71.09	PASS
Band4	5MHz	QPSK	20375	1	5	High	0.15	30	-73.85	PASS
Band4	5MHz	QPSK	20375	1	5	High	30	1000	-51.17	PASS
Band4	5MHz	QPSK	20375	1	5	High	1000	20000	-41.65	PASS
Band4	5MHz	16QAM	20375	1	5	High	0.009	0.15	-72.13	PASS
Band4	5MHz	16QAM	20375	1	5	High	0.15	30	-74.84	PASS
Band4	5MHz	16QAM	20375	1	5	High	30	1000	-51.13	PASS
Band4	5MHz	16QAM	20375	1	5	High	1000	20000	-41.54	PASS
Band4	10MHz	QPSK	20000	1	0	Low	0.009	0.15	-72.97	PASS
Band4	10MHz	QPSK	20000	1	0	Low	0.15	30	-74.5	PASS
Band4	10MHz	QPSK	20000	1	0	Low	30	1000	-51.22	PASS
Band4	10MHz	QPSK	20000	1	0	Low	1000	20000	-41.63	PASS
Band4	10MHz	16QAM	20000	1	0	Low	0.009	0.15	-72.14	PASS
Band4	10MHz	16QAM	20000	1	0	Low	0.15	30	-72.13	PASS
Band4	10MHz	16QAM	20000	1	0	Low	30	1000	-51.13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com