

Appendix Test Data

Report No:	1816C50010012503	Test Sample NO:	1-2-2
Start Test Date:	2025-06-27	Finish Test Date:	2025-07-2
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.3°C	Relative Humidity:	56%
Pressure:	101 kPa		

Appendix A: Conducted Output Power for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Conducted Power(dBm)	Verdict
Band5	1.4MHz	QPSK	20407	1	0	Low	23.37	PASS
Band5	1.4MHz	QPSK	20407	1	5	Low	23.06	PASS
Band5	1.4MHz	QPSK	20407	6	0	Low	21.10	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	22.28	PASS
Band5	1.4MHz	16QAM	20407	1	5	Low	21.85	PASS
Band5	1.4MHz	16QAM	20407	6	0	Low	21.23	PASS
Band5	1.4MHz	QPSK	20525	1	0	Low	23.49	PASS
Band5	1.4MHz	QPSK	20525	1	5	Low	23.32	PASS
Band5	1.4MHz	QPSK	20525	6	0	Low	21.16	PASS
Band5	1.4MHz	16QAM	20525	1	0	Low	22.11	PASS
Band5	1.4MHz	16QAM	20525	1	5	Low	21.89	PASS
Band5	1.4MHz	16QAM	20525	6	0	Low	21.25	PASS
Band5	1.4MHz	QPSK	20643	1	0	High	23.53	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	23.55	PASS
Band5	1.4MHz	QPSK	20643	6	0	High	21.59	PASS
Band5	1.4MHz	16QAM	20643	1	0	High	22.85	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	22.66	PASS
Band5	1.4MHz	16QAM	20643	6	0	High	21.51	PASS
Band5	3MHz	QPSK	20415	1	0	Low	23.66	PASS
Band5	3MHz	QPSK	20415	1	5	Low	23.41	PASS
Band5	3MHz	QPSK	20415	6	0	Low	21.21	PASS
Band5	3MHz	16QAM	20415	1	0	Low	22.16	PASS
Band5	3MHz	16QAM	20415	1	5	Low	21.99	PASS
Band5	3MHz	16QAM	20415	6	0	Low	21.35	PASS
Band5	3MHz	QPSK	20525	1	0	Low	23.48	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band5	3MHz	QPSK	20525	1	5	Low	23.32	PASS
Band5	3MHz	QPSK	20525	6	0	Low	21.13	PASS
Band5	3MHz	16QAM	20525	1	0	Low	22.09	PASS
Band5	3MHz	16QAM	20525	1	5	Low	21.86	PASS
Band5	3MHz	16QAM	20525	6	0	Low	21.23	PASS
Band5	3MHz	QPSK	20635	1	0	High	23.81	PASS
Band5	3MHz	QPSK	20635	1	5	High	23.73	PASS
Band5	3MHz	QPSK	20635	6	0	High	21.37	PASS
Band5	3MHz	16QAM	20635	1	0	High	22.61	PASS
Band5	3MHz	16QAM	20635	1	5	High	22.21	PASS
Band5	3MHz	16QAM	20635	6	0	High	21.58	PASS
Band5	5MHz	QPSK	20425	1	0	Low	23.66	PASS
Band5	5MHz	QPSK	20425	1	5	Low	23.40	PASS
Band5	5MHz	QPSK	20425	6	0	Low	22.51	PASS
Band5	5MHz	16QAM	20425	1	0	Low	23.12	PASS
Band5	5MHz	16QAM	20425	1	5	Low	22.91	PASS
Band5	5MHz	16QAM	20425	6	0	Low	22.50	PASS
Band5	5MHz	QPSK	20525	1	0	Low	23.52	PASS
Band5	5MHz	QPSK	20525	1	5	Low	23.34	PASS
Band5	5MHz	QPSK	20525	6	0	Low	22.45	PASS
Band5	5MHz	16QAM	20525	1	0	Low	23.01	PASS
Band5	5MHz	16QAM	20525	1	5	Low	22.84	PASS
Band5	5MHz	16QAM	20525	6	0	Low	22.44	PASS
Band5	5MHz	QPSK	20625	1	0	High	23.64	PASS
Band5	5MHz	QPSK	20625	1	5	High	23.77	PASS
Band5	5MHz	QPSK	20625	6	0	High	22.87	PASS
Band5	5MHz	16QAM	20625	1	0	High	23.51	PASS
Band5	5MHz	16QAM	20625	1	5	High	23.08	PASS
Band5	5MHz	16QAM	20625	6	0	High	22.75	PASS
Band5	10MHz	QPSK	20450	1	0	Low	23.51	PASS
Band5	10MHz	QPSK	20450	1	5	Low	23.34	PASS
Band5	10MHz	QPSK	20450	6	0	Low	22.21	PASS
Band5	10MHz	16QAM	20450	1	0	Low	22.94	PASS
Band5	10MHz	16QAM	20450	1	5	Low	22.84	PASS
Band5	10MHz	16QAM	20450	6	0	Low	22.31	PASS
Band5	10MHz	QPSK	20525	1	0	Low	23.45	PASS
Band5	10MHz	QPSK	20525	1	5	Low	23.29	PASS
Band5	10MHz	QPSK	20525	6	0	Low	22.06	PASS
Band5	10MHz	16QAM	20525	1	0	Low	22.93	PASS
Band5	10MHz	16QAM	20525	1	5	Low	22.80	PASS
Band5	10MHz	16QAM	20525	6	0	Low	22.32	PASS
Band5	10MHz	QPSK	20600	1	0	High	23.59	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band5	10MHz	QPSK	20600	1	5	High	23.70	PASS
Band5	10MHz	QPSK	20600	6	0	High	22.87	PASS
Band5	10MHz	16QAM	20600	1	0	High	23.01	PASS
Band5	10MHz	16QAM	20600	1	5	High	23.05	PASS
Band5	10MHz	16QAM	20600	6	0	High	22.74	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF) for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Result(dB)	Limit(dB)	Verdict
Band5	1.4MHz	QPSK	20407	1	0	Low	1.76	<=13	PASS
Band5	1.4MHz	QPSK	20407	6	0	Low	4.62	<=13	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	3.16	<=13	PASS
Band5	1.4MHz	16QAM	20407	6	0	Low	4.62	<=13	PASS
Band5	1.4MHz	QPSK	20525	1	0	Low	1.62	<=13	PASS
Band5	1.4MHz	QPSK	20525	6	0	Low	4.19	<=13	PASS
Band5	1.4MHz	16QAM	20525	1	0	Low	3.03	<=13	PASS
Band5	1.4MHz	16QAM	20525	6	0	Low	4.19	<=13	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	1.09	<=13	PASS
Band5	1.4MHz	QPSK	20643	6	0	High	3.94	<=13	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	2.67	<=13	PASS
Band5	1.4MHz	16QAM	20643	6	0	High	3.95	<=13	PASS
Band5	3MHz	QPSK	20415	1	0	Low	1.49	<=13	PASS
Band5	3MHz	QPSK	20415	6	0	Low	3.83	<=13	PASS
Band5	3MHz	16QAM	20415	1	0	Low	2.93	<=13	PASS
Band5	3MHz	16QAM	20415	6	0	Low	3.83	<=13	PASS
Band5	3MHz	QPSK	20525	1	0	Low	1.48	<=13	PASS
Band5	3MHz	QPSK	20525	6	0	Low	3.86	<=13	PASS
Band5	3MHz	16QAM	20525	1	0	Low	2.99	<=13	PASS
Band5	3MHz	16QAM	20525	6	0	Low	3.86	<=13	PASS
Band5	3MHz	QPSK	20635	1	5	High	1.01	<=13	PASS
Band5	3MHz	QPSK	20635	6	0	High	3.33	<=13	PASS
Band5	3MHz	16QAM	20635	1	5	High	2.66	<=13	PASS
Band5	3MHz	16QAM	20635	6	0	High	3.34	<=13	PASS
Band5	5MHz	QPSK	20425	1	0	Low	2.37	<=13	PASS
Band5	5MHz	QPSK	20425	6	0	Low	3.82	<=13	PASS
Band5	5MHz	16QAM	20425	1	0	Low	2.25	<=13	PASS
Band5	5MHz	16QAM	20425	6	0	Low	3.84	<=13	PASS
Band5	5MHz	QPSK	20525	1	0	Low	2.48	<=13	PASS
Band5	5MHz	QPSK	20525	6	0	Low	3.80	<=13	PASS
Band5	5MHz	16QAM	20525	1	0	Low	2.25	<=13	PASS
Band5	5MHz	16QAM	20525	6	0	Low	3.83	<=13	PASS
Band5	5MHz	QPSK	20625	1	5	High	1.08	<=13	PASS
Band5	5MHz	QPSK	20625	6	0	High	2.72	<=13	PASS
Band5	5MHz	16QAM	20625	1	5	High	1.83	<=13	PASS
Band5	5MHz	16QAM	20625	6	0	High	2.76	<=13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band5	10MHz	QPSK	20450	1	0	Low	1.50	<=13	PASS
Band5	10MHz	QPSK	20450	6	0	Low	2.83	<=13	PASS
Band5	10MHz	16QAM	20450	1	0	Low	2.14	<=13	PASS
Band5	10MHz	16QAM	20450	6	0	Low	2.84	<=13	PASS
Band5	10MHz	QPSK	20525	1	0	Low	1.54	<=13	PASS
Band5	10MHz	QPSK	20525	6	0	Low	2.86	<=13	PASS
Band5	10MHz	16QAM	20525	1	0	Low	2.12	<=13	PASS
Band5	10MHz	16QAM	20525	6	0	Low	2.87	<=13	PASS
Band5	10MHz	QPSK	20600	1	5	High	1.05	<=13	PASS
Band5	10MHz	QPSK	20600	6	0	High	2.31	<=13	PASS
Band5	10MHz	16QAM	20600	1	5	High	1.76	<=13	PASS
Band5	10MHz	16QAM	20600	6	0	High	2.32	<=13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

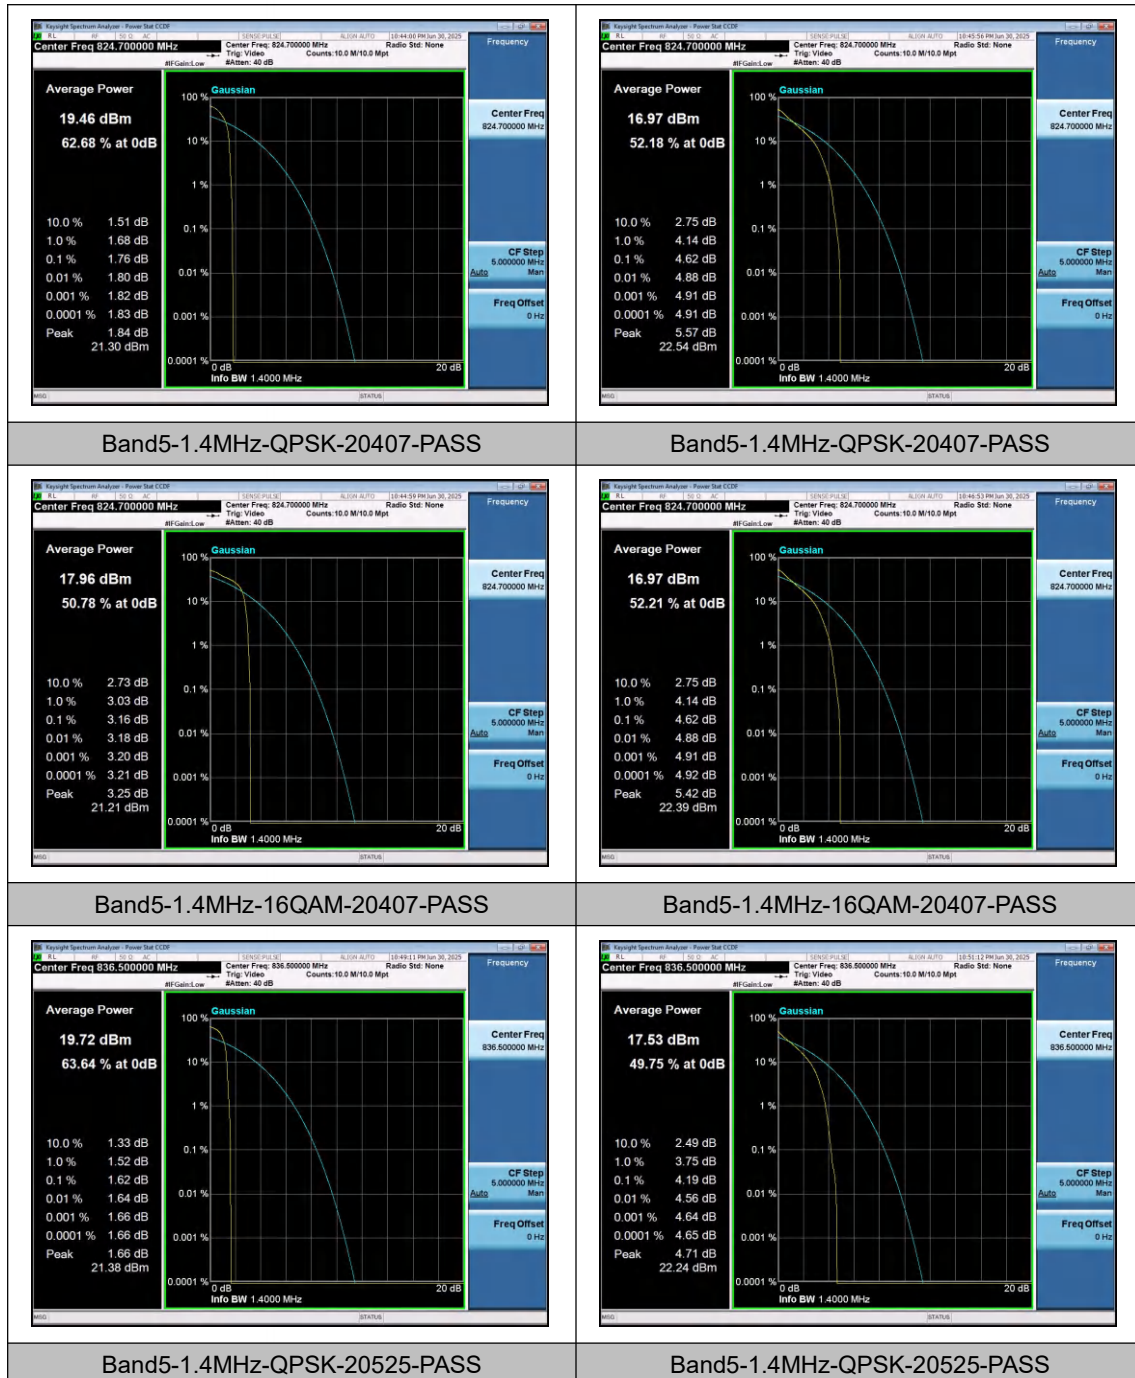


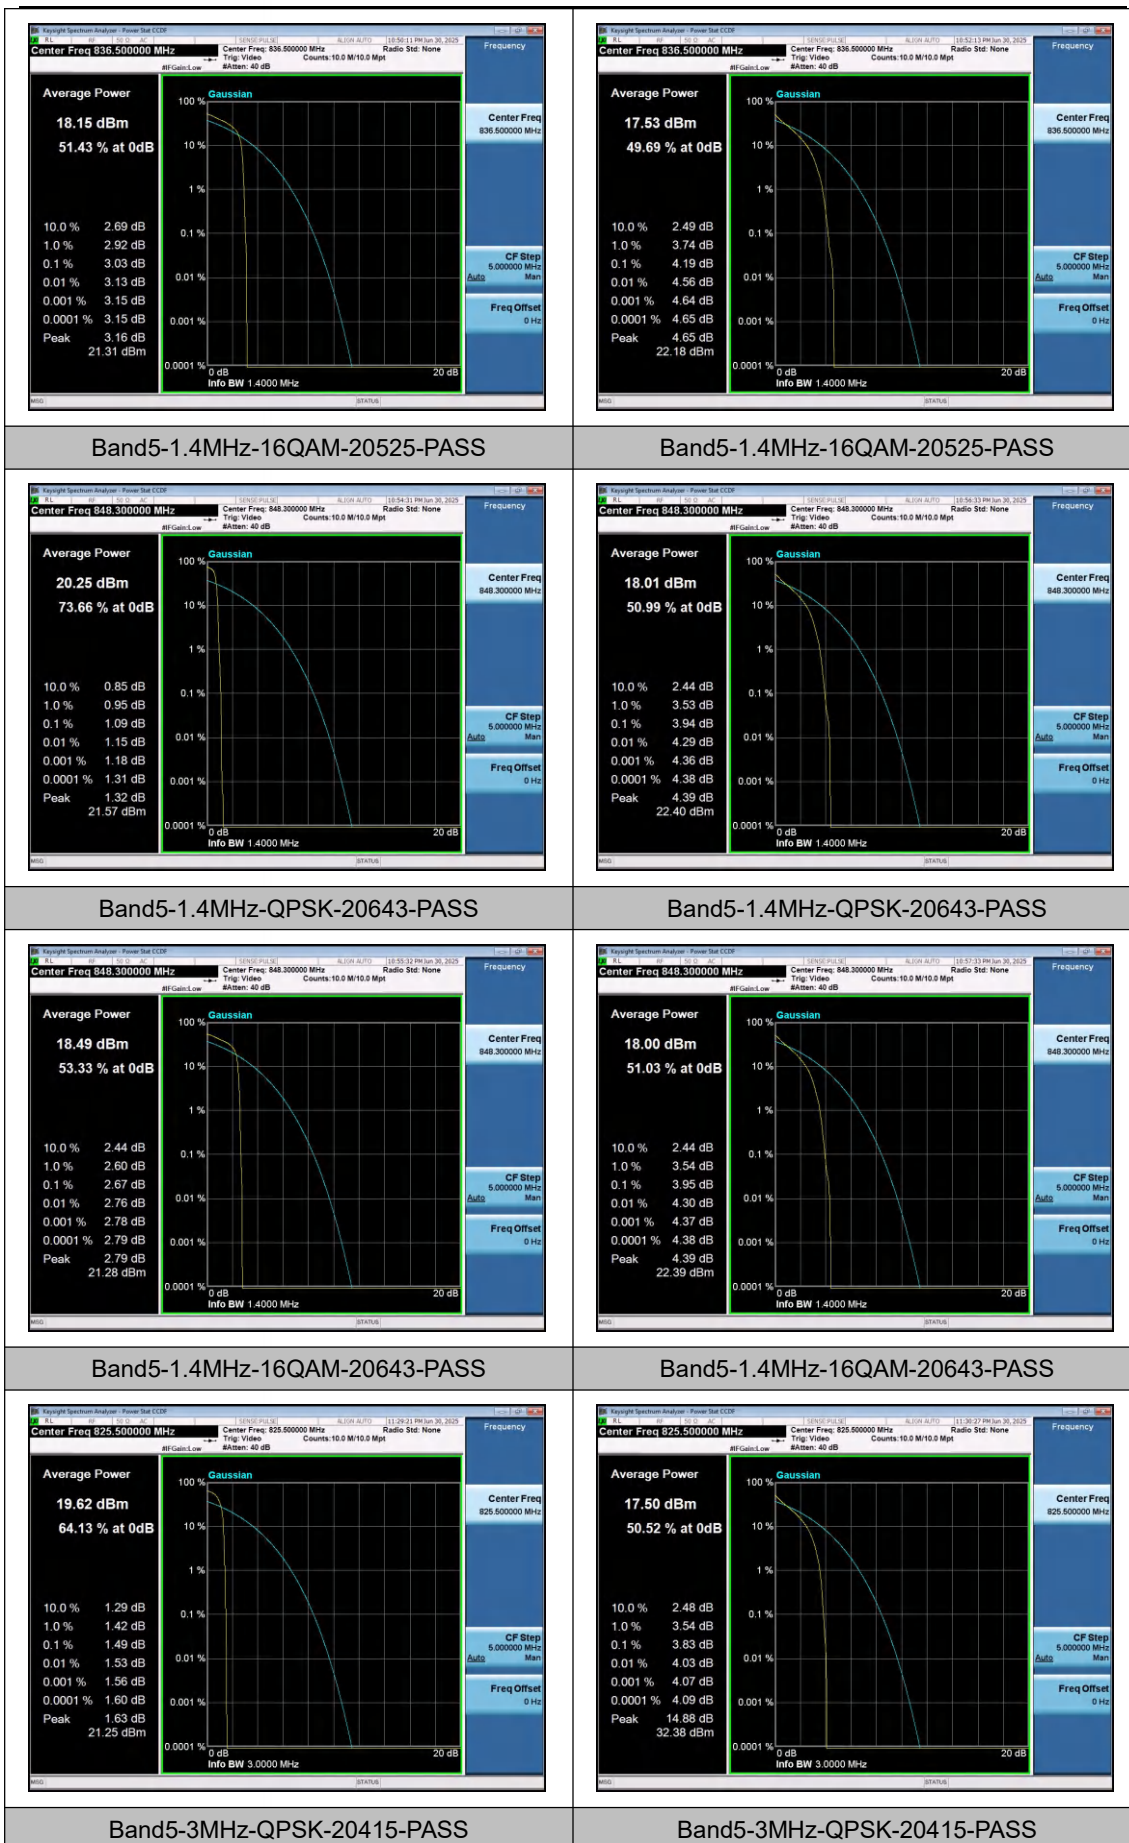


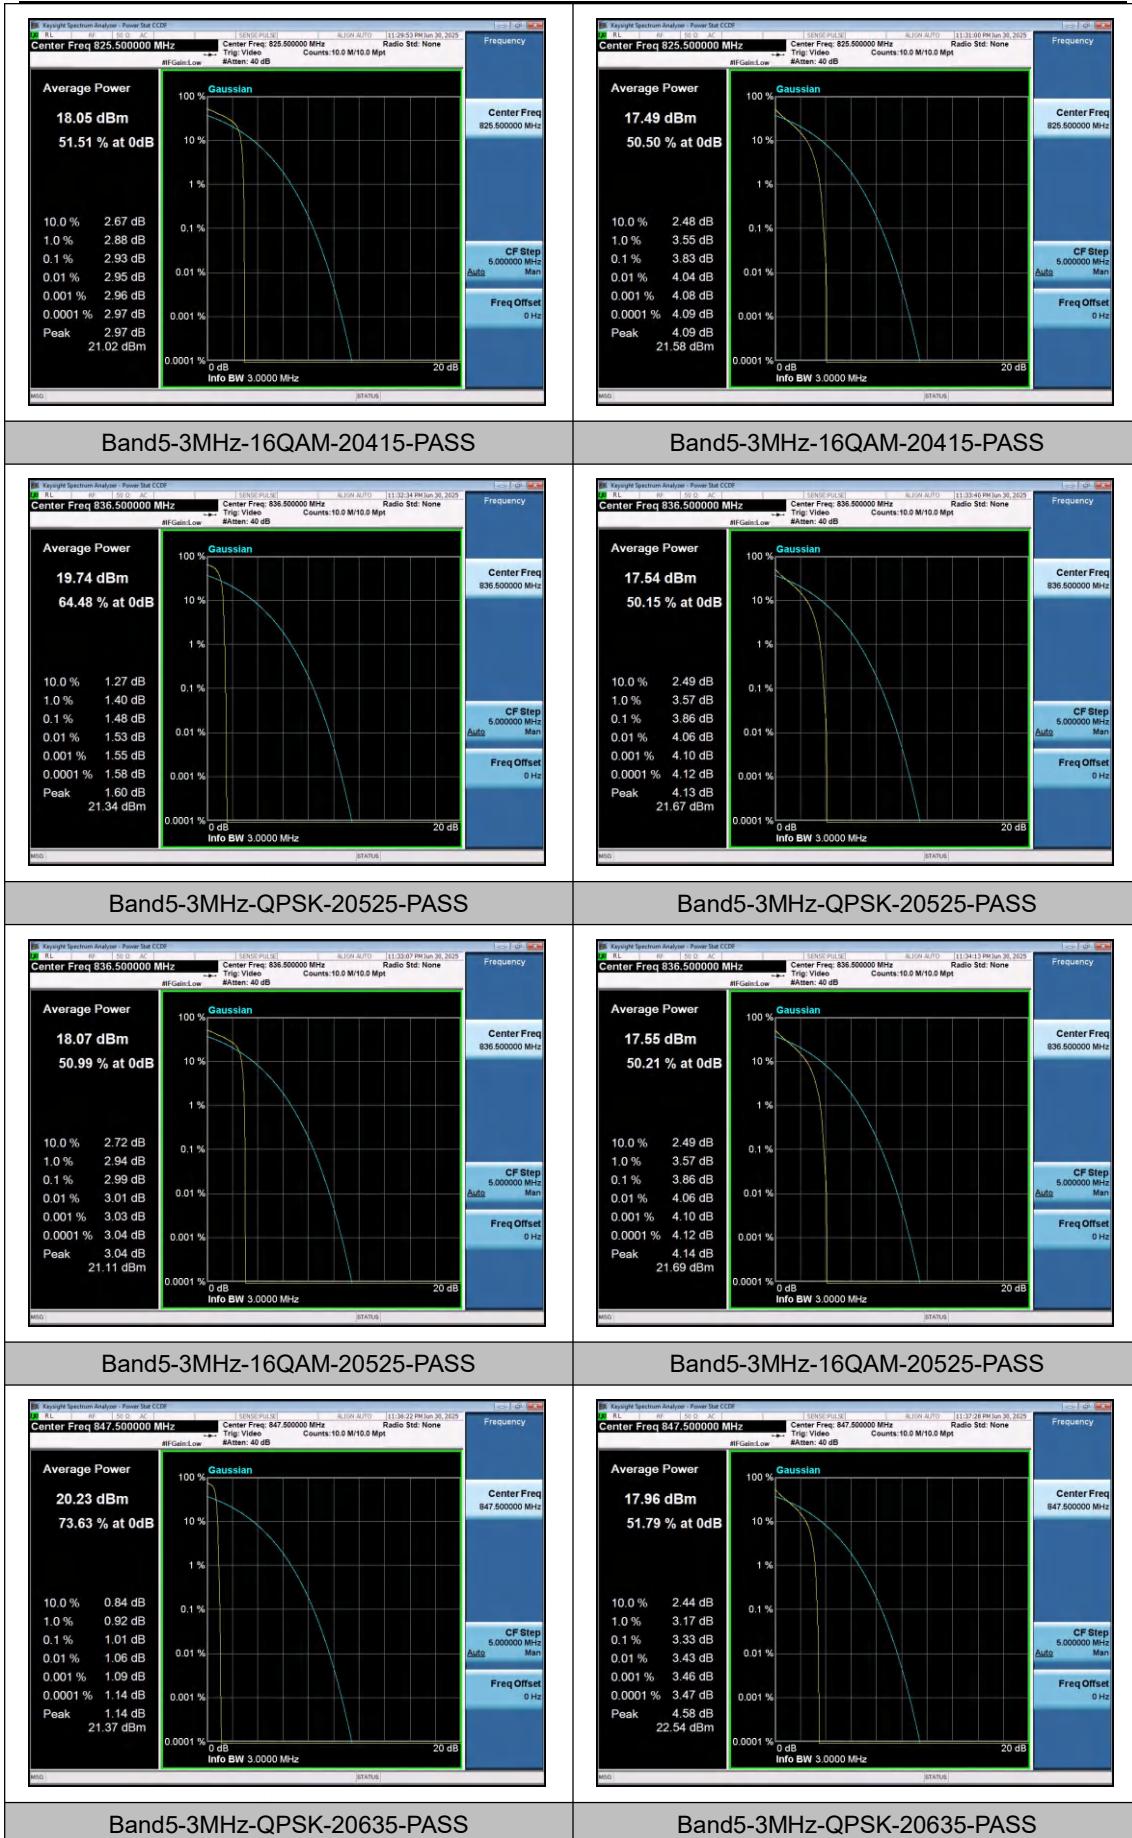

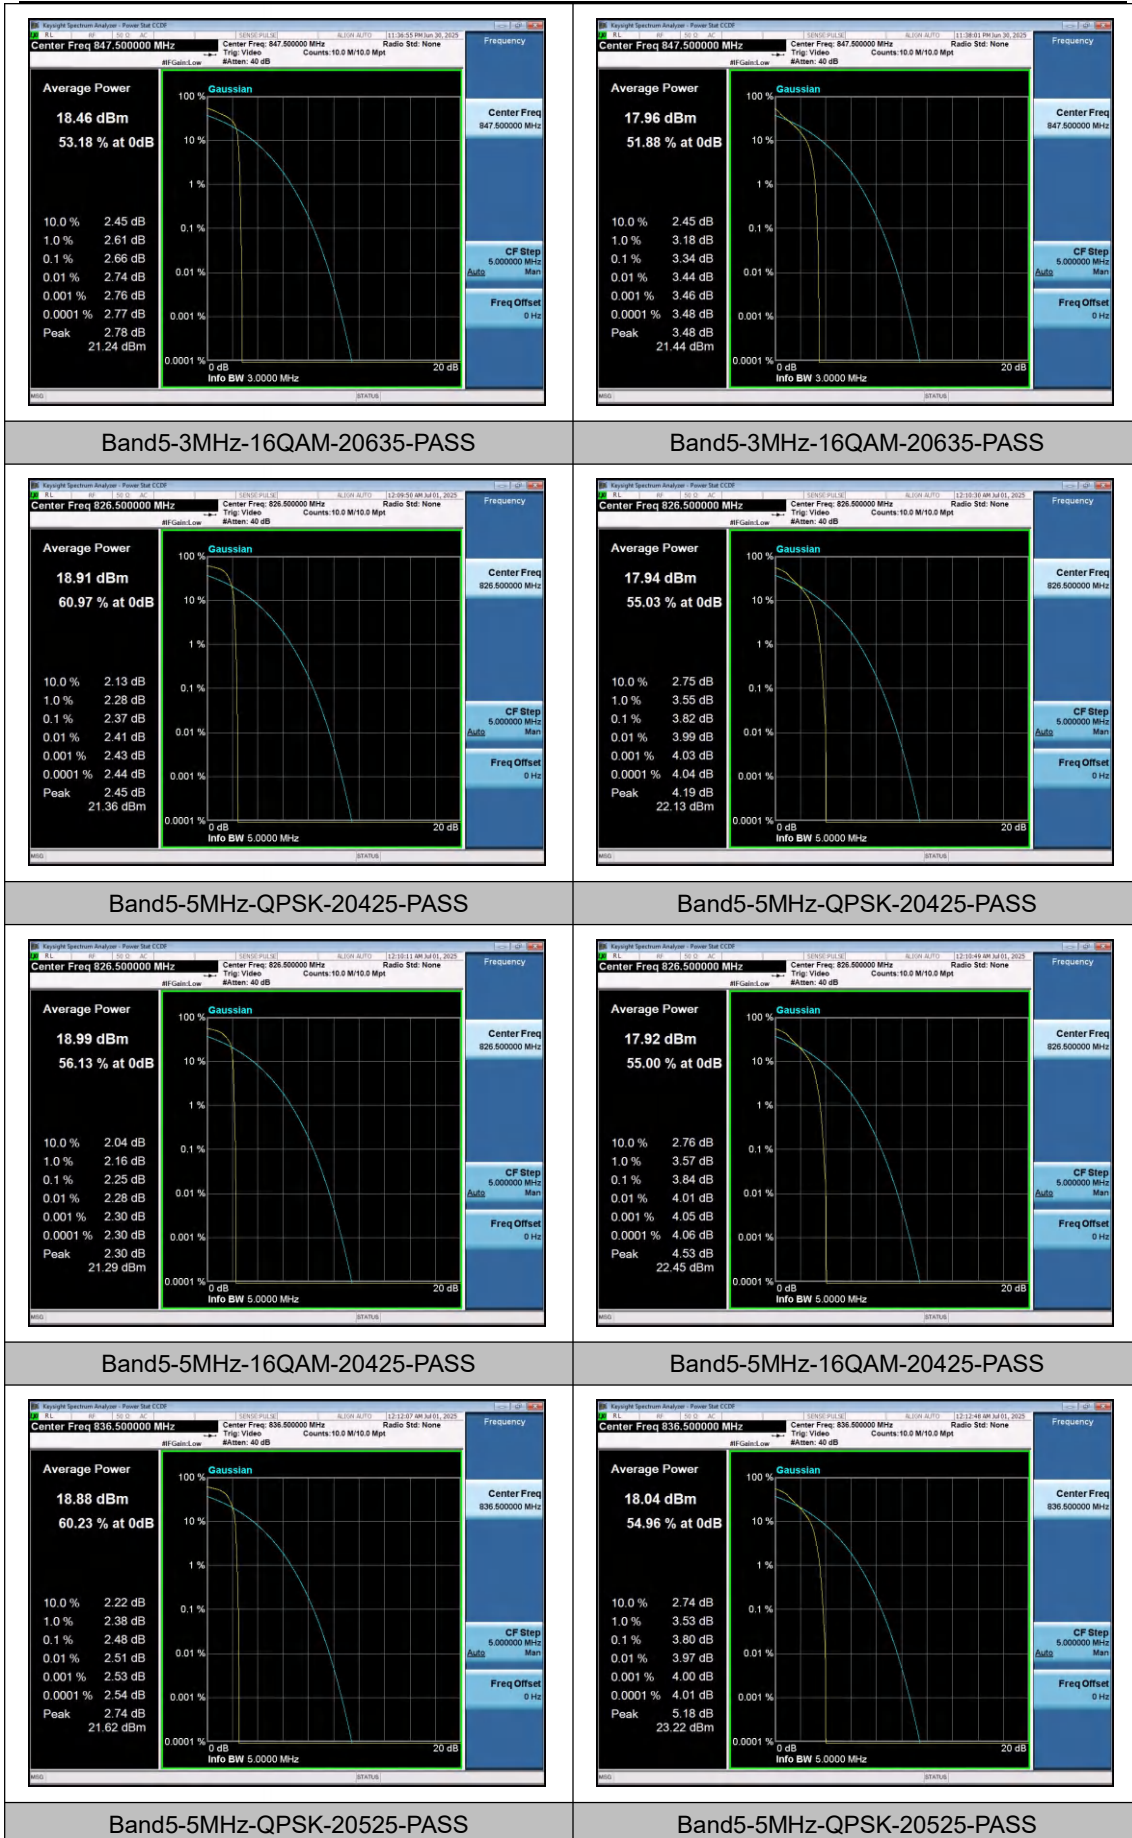

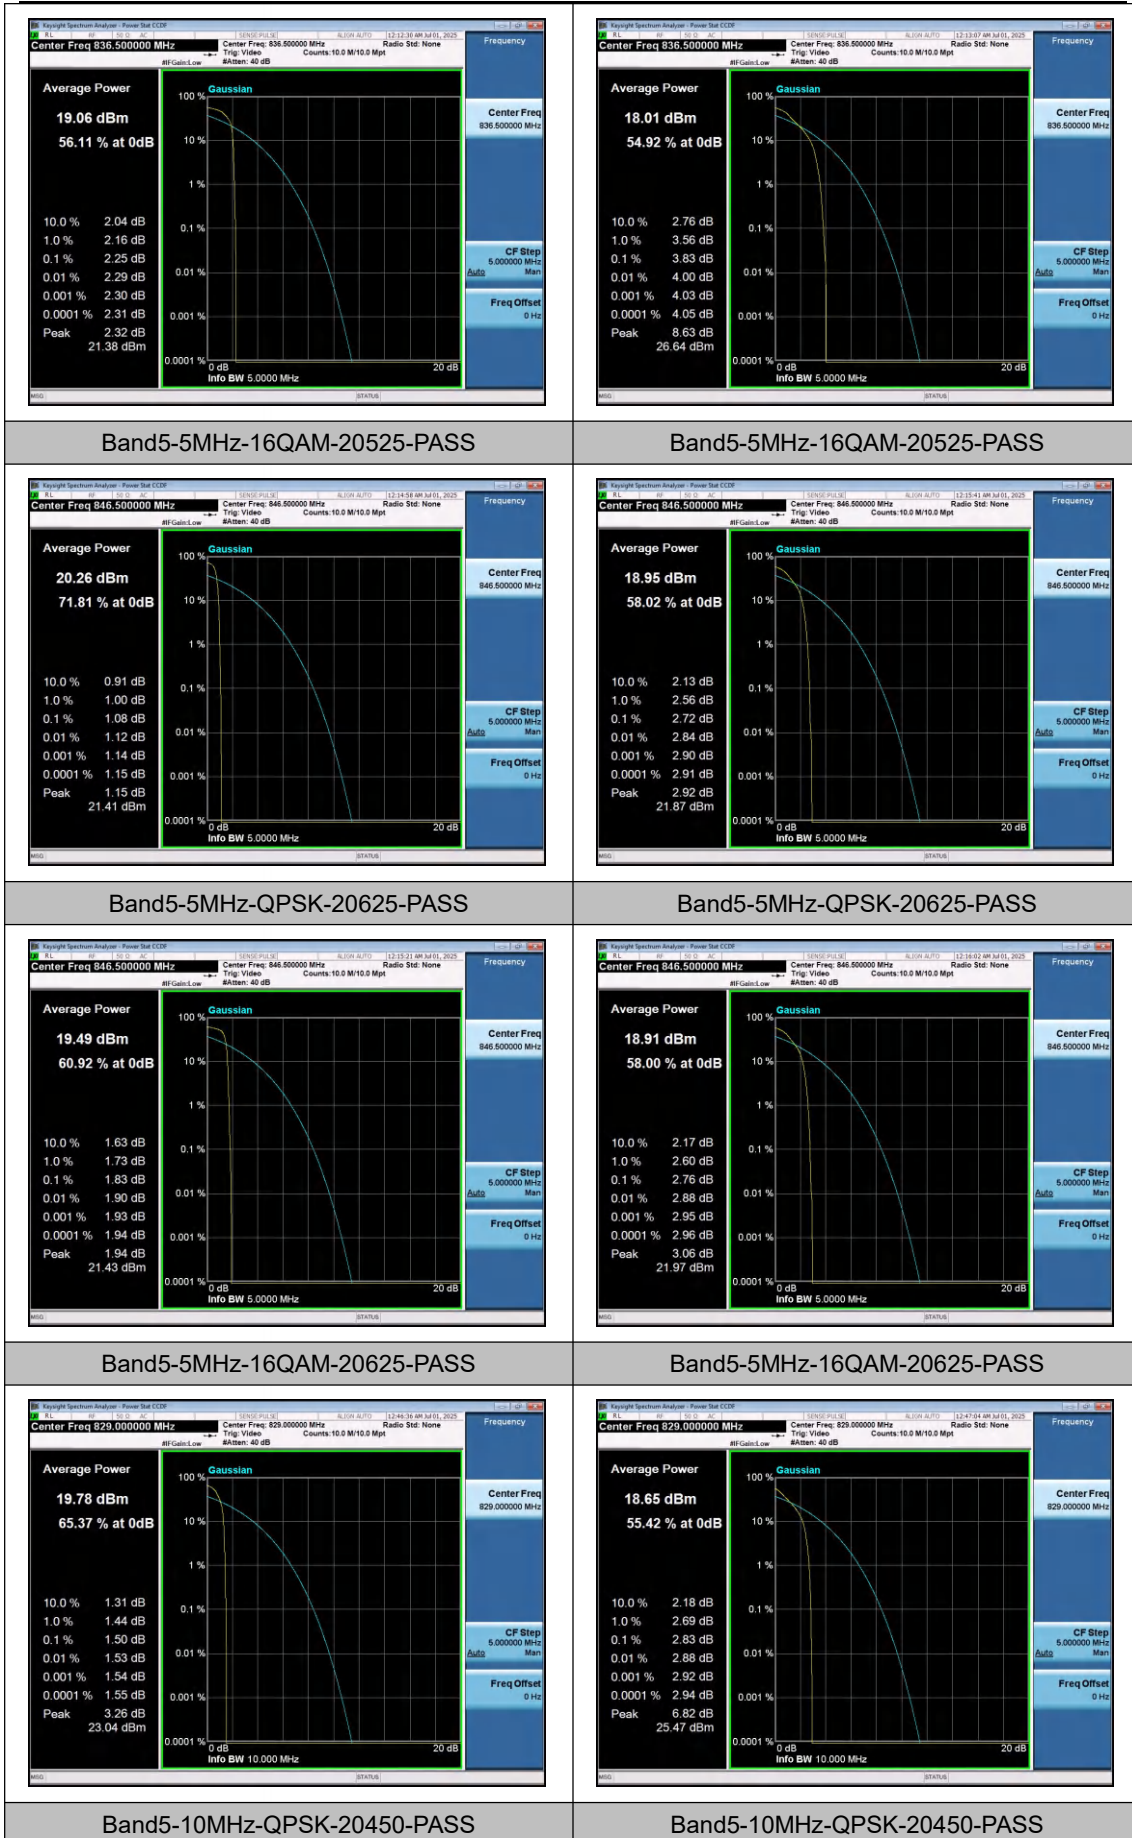

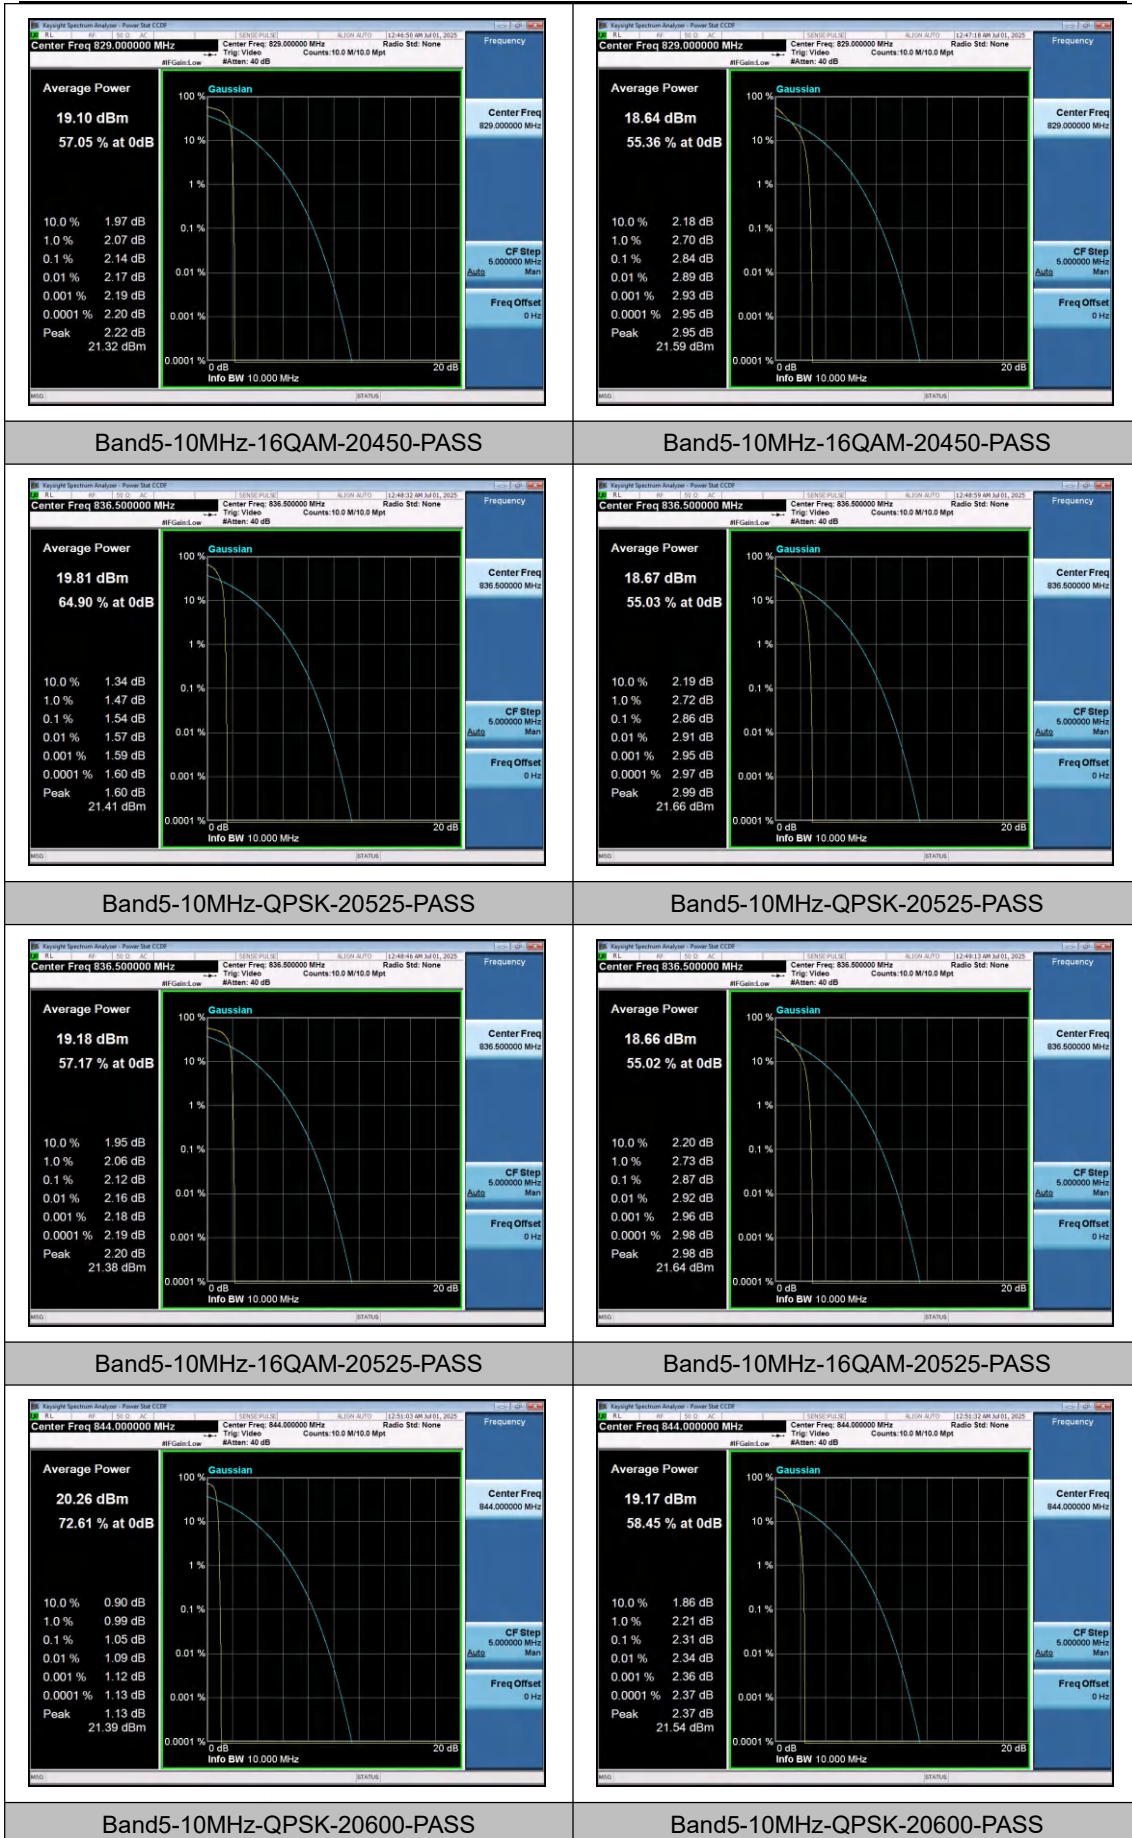

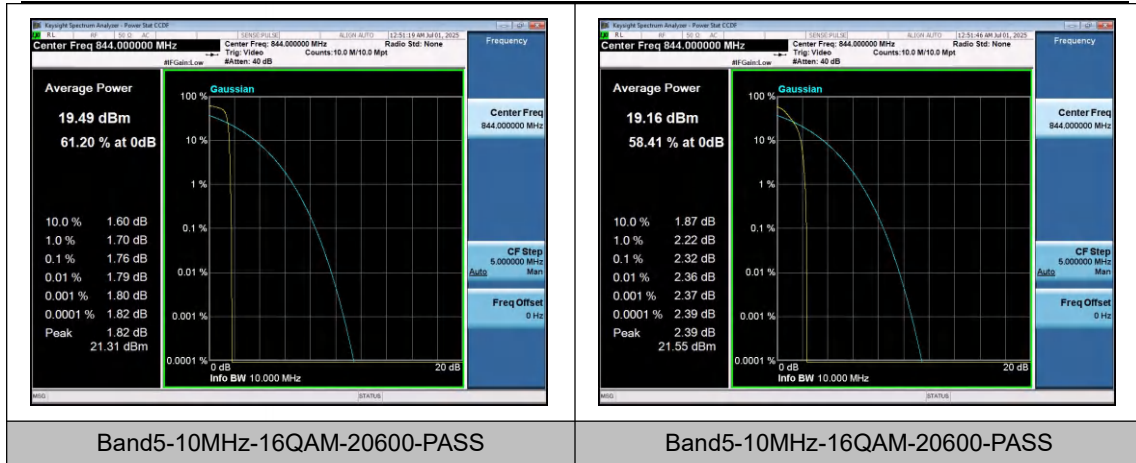

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix C: 26dB Bandwidth and Occupied Bandwidth for M1


Test Result


Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band5	1.4MHz	QPSK	20407	6	0	Low	1.0820	1.358	PASS
Band5	1.4MHz	16QAM	20407	6	0	Low	1.0827	1.329	PASS
Band5	1.4MHz	QPSK	20525	6	0	Low	1.0939	1.291	PASS
Band5	1.4MHz	16QAM	20525	6	0	Low	1.0920	1.287	PASS
Band5	1.4MHz	QPSK	20643	6	0	High	1.0968	1.317	PASS
Band5	1.4MHz	16QAM	20643	6	0	High	1.0985	1.307	PASS
Band5	3MHz	QPSK	20415	6	0	Low	1.1152	1.387	PASS
Band5	3MHz	16QAM	20415	6	0	Low	1.1184	1.374	PASS
Band5	3MHz	QPSK	20525	6	0	Low	1.1193	1.369	PASS
Band5	3MHz	16QAM	20525	6	0	Low	1.1140	1.353	PASS
Band5	3MHz	QPSK	20635	6	0	High	1.1182	1.442	PASS
Band5	3MHz	16QAM	20635	6	0	High	1.1188	1.508	PASS
Band5	5MHz	QPSK	20425	6	0	Low	1.2289	2.172	PASS
Band5	5MHz	16QAM	20425	6	0	Low	1.2273	2.220	PASS
Band5	5MHz	QPSK	20525	6	0	Low	1.2307	2.224	PASS
Band5	5MHz	16QAM	20525	6	0	Low	1.2249	2.204	PASS
Band5	5MHz	QPSK	20625	6	0	High	1.2634	2.295	PASS
Band5	5MHz	16QAM	20625	6	0	High	1.2571	2.300	PASS
Band5	10MHz	QPSK	20450	6	0	Low	1.4008	2.744	PASS
Band5	10MHz	16QAM	20450	6	0	Low	1.4006	2.769	PASS
Band5	10MHz	QPSK	20525	6	0	Low	1.3938	2.761	PASS
Band5	10MHz	16QAM	20525	6	0	Low	1.4076	2.752	PASS
Band5	10MHz	QPSK	20600	6	0	High	1.4887	2.902	PASS
Band5	10MHz	16QAM	20600	6	0	High	1.4823	2.973	PASS

Test Graphs

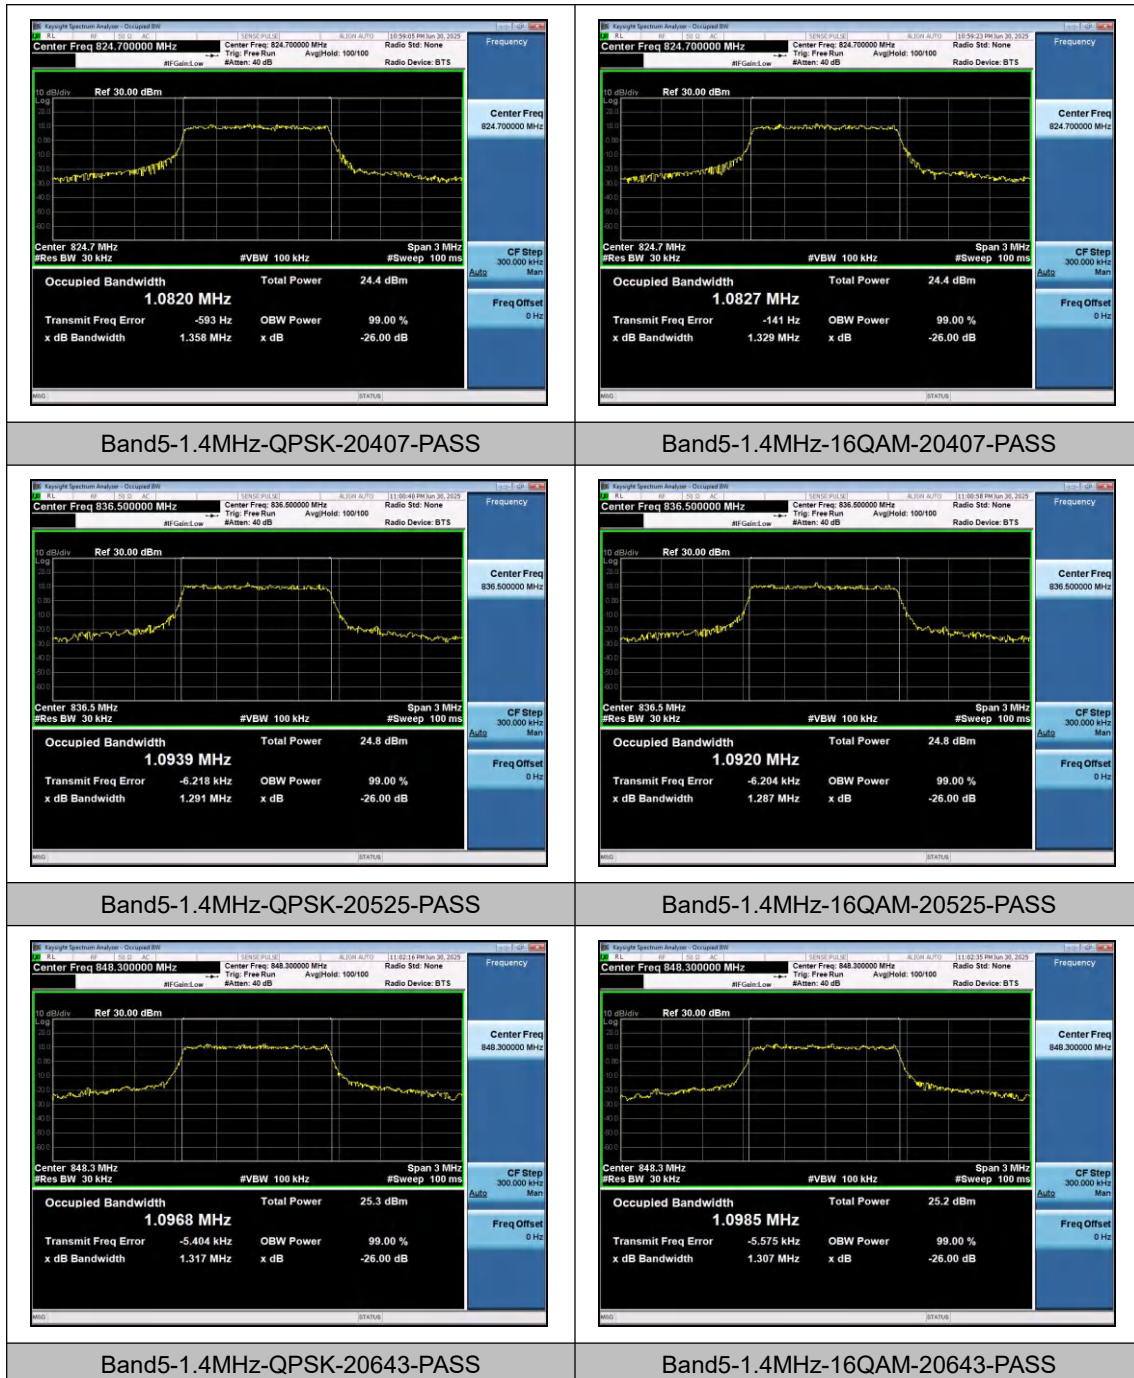

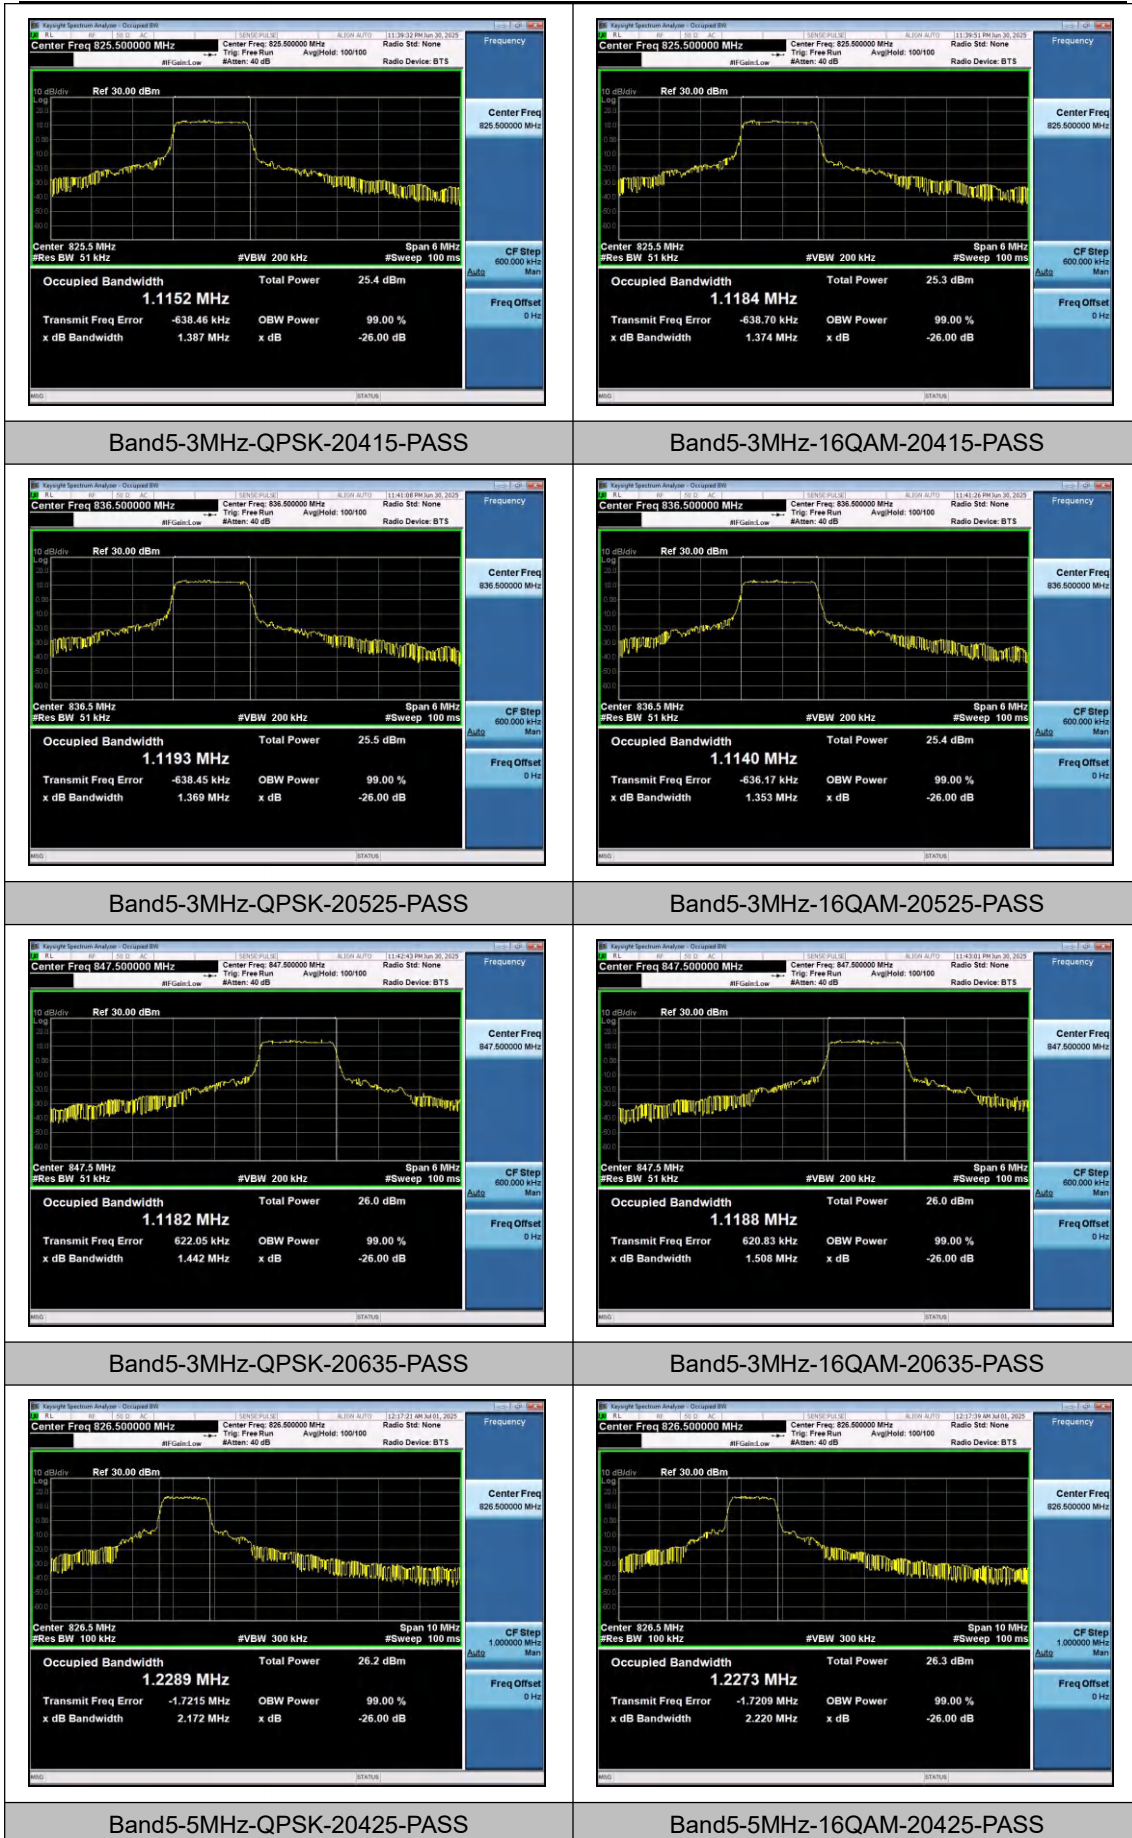

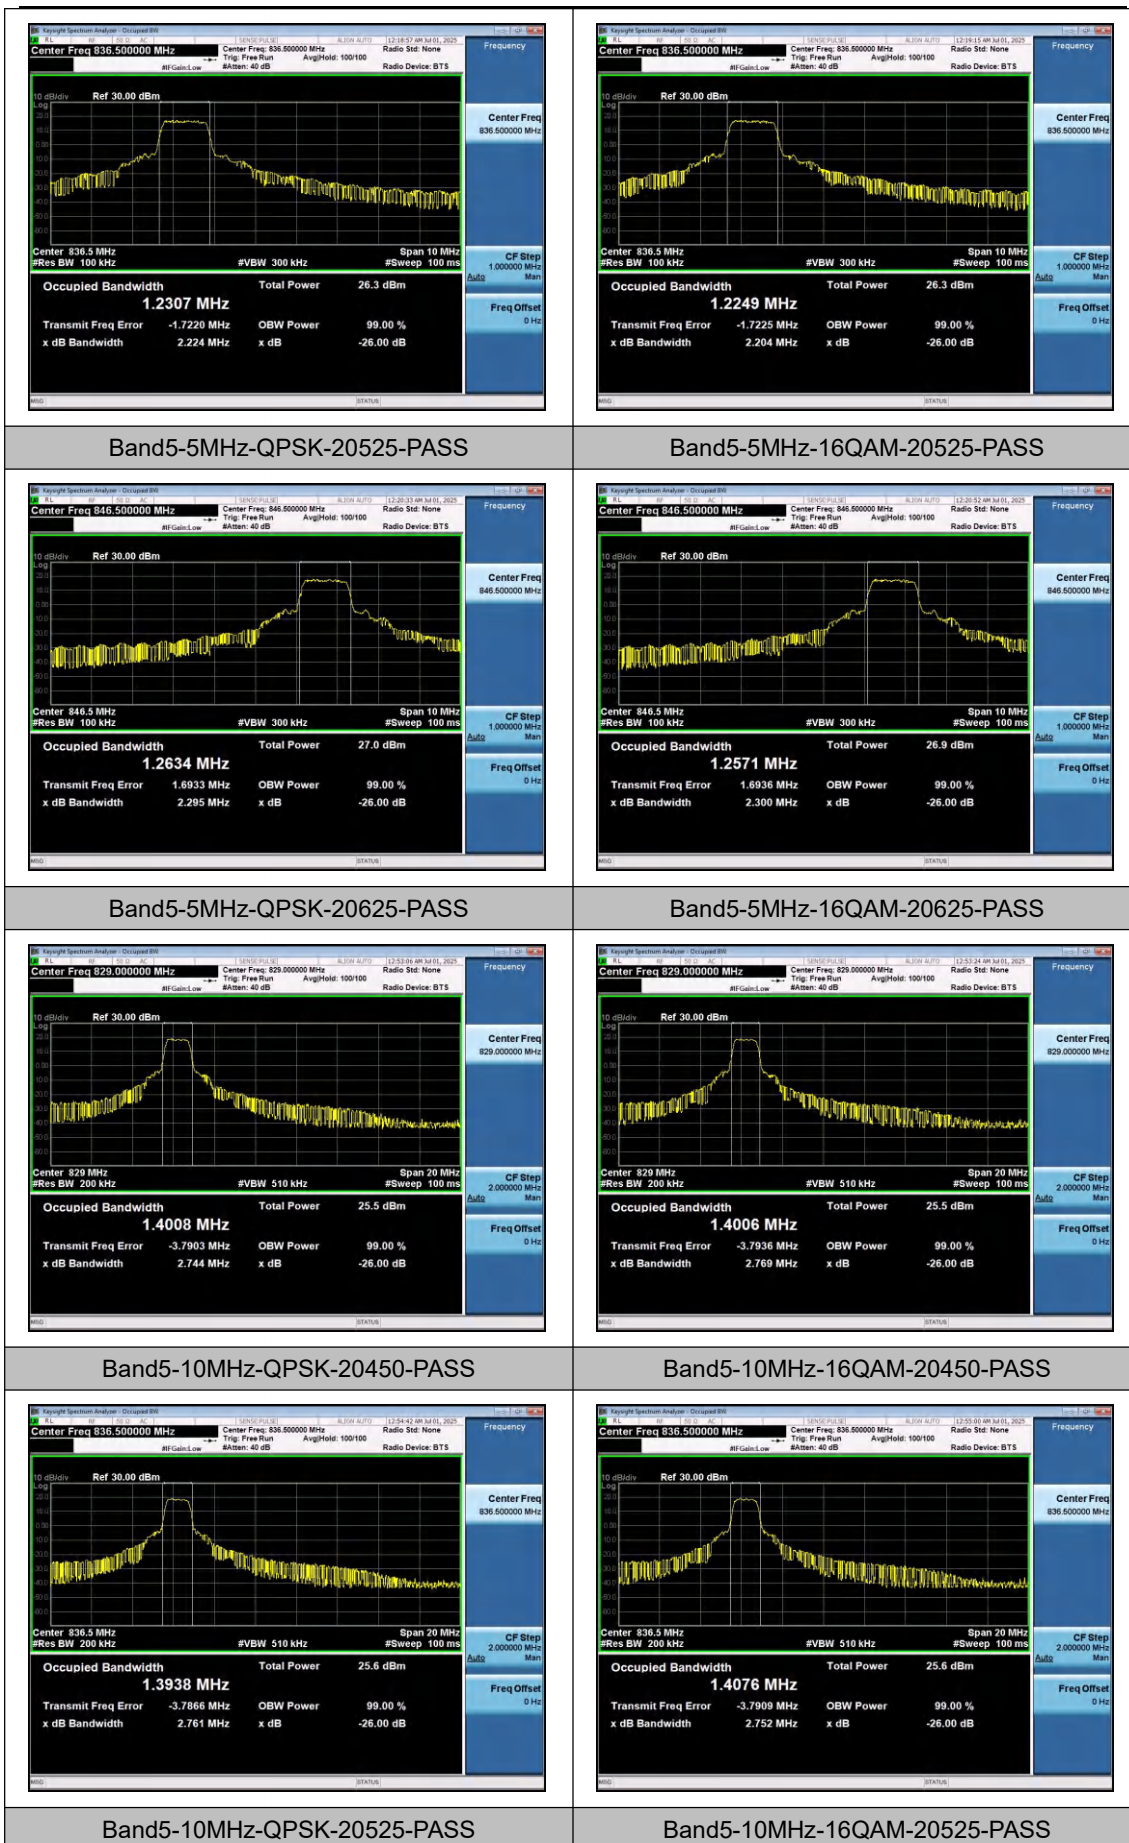

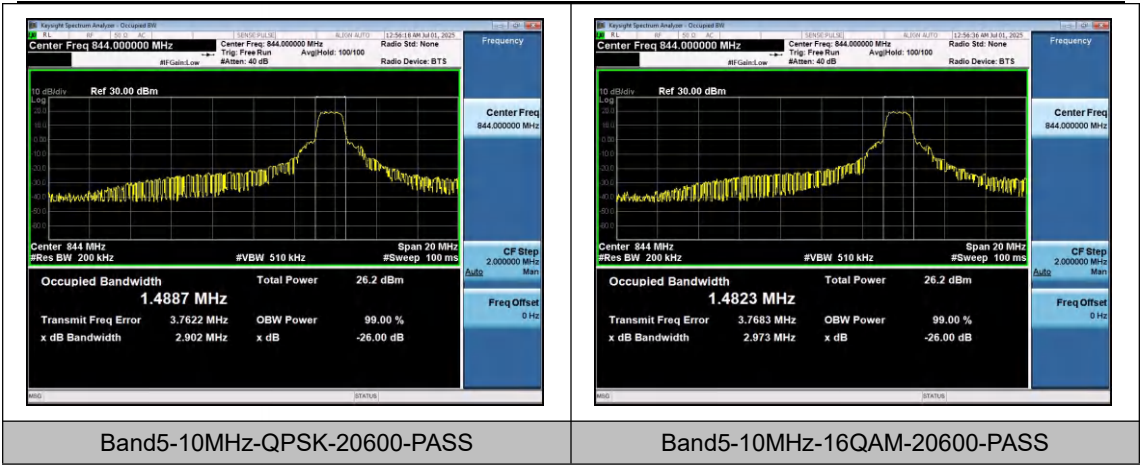

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix D: Band Edge for M1


Test Result


Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Result(dBm)	Verdict
Band5	1.4MHz	QPSK	20407	1	0	Low	-22.07	PASS
Band5	1.4MHz	QPSK	20407	6	0	Low	-42.86	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	-37.46	PASS
Band5	1.4MHz	16QAM	20407	6	0	Low	-32.99	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	-53.37	PASS
Band5	1.4MHz	QPSK	20643	6	0	High	-61.70	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	-64.66	PASS
Band5	1.4MHz	16QAM	20643	6	0	High	-50.04	PASS
Band5	3MHz	QPSK	20415	1	0	Low	-53.26	PASS
Band5	3MHz	QPSK	20415	6	0	Low	-41.81	PASS
Band5	3MHz	16QAM	20415	1	0	Low	-60.29	PASS
Band5	3MHz	16QAM	20415	6	0	Low	-45.43	PASS
Band5	3MHz	QPSK	20635	1	5	High	-53.04	PASS
Band5	3MHz	QPSK	20635	6	0	High	-44.04	PASS
Band5	3MHz	16QAM	20635	1	5	High	-65.25	PASS
Band5	3MHz	16QAM	20635	6	0	High	-48.64	PASS
Band5	5MHz	QPSK	20425	1	0	Low	-33.77	PASS
Band5	5MHz	QPSK	20425	6	0	Low	-41.13	PASS
Band5	5MHz	16QAM	20425	1	0	Low	-35.42	PASS
Band5	5MHz	16QAM	20425	6	0	Low	-30.09	PASS
Band5	5MHz	QPSK	20625	1	5	High	-48.39	PASS
Band5	5MHz	QPSK	20625	6	0	High	-26.30	PASS
Band5	5MHz	16QAM	20625	1	5	High	-52.84	PASS
Band5	5MHz	16QAM	20625	6	0	High	-31.56	PASS
Band5	10MHz	QPSK	20450	1	0	Low	-47.69	PASS
Band5	10MHz	QPSK	20450	6	0	Low	-33.10	PASS
Band5	10MHz	16QAM	20450	1	0	Low	-52.18	PASS
Band5	10MHz	16QAM	20450	6	0	Low	-34.02	PASS
Band5	10MHz	QPSK	20600	1	5	High	-59.32	PASS
Band5	10MHz	QPSK	20600	6	0	High	-33.05	PASS
Band5	10MHz	16QAM	20600	1	5	High	-57.02	PASS
Band5	10MHz	16QAM	20600	6	0	High	-28.88	PASS


Test Graphs

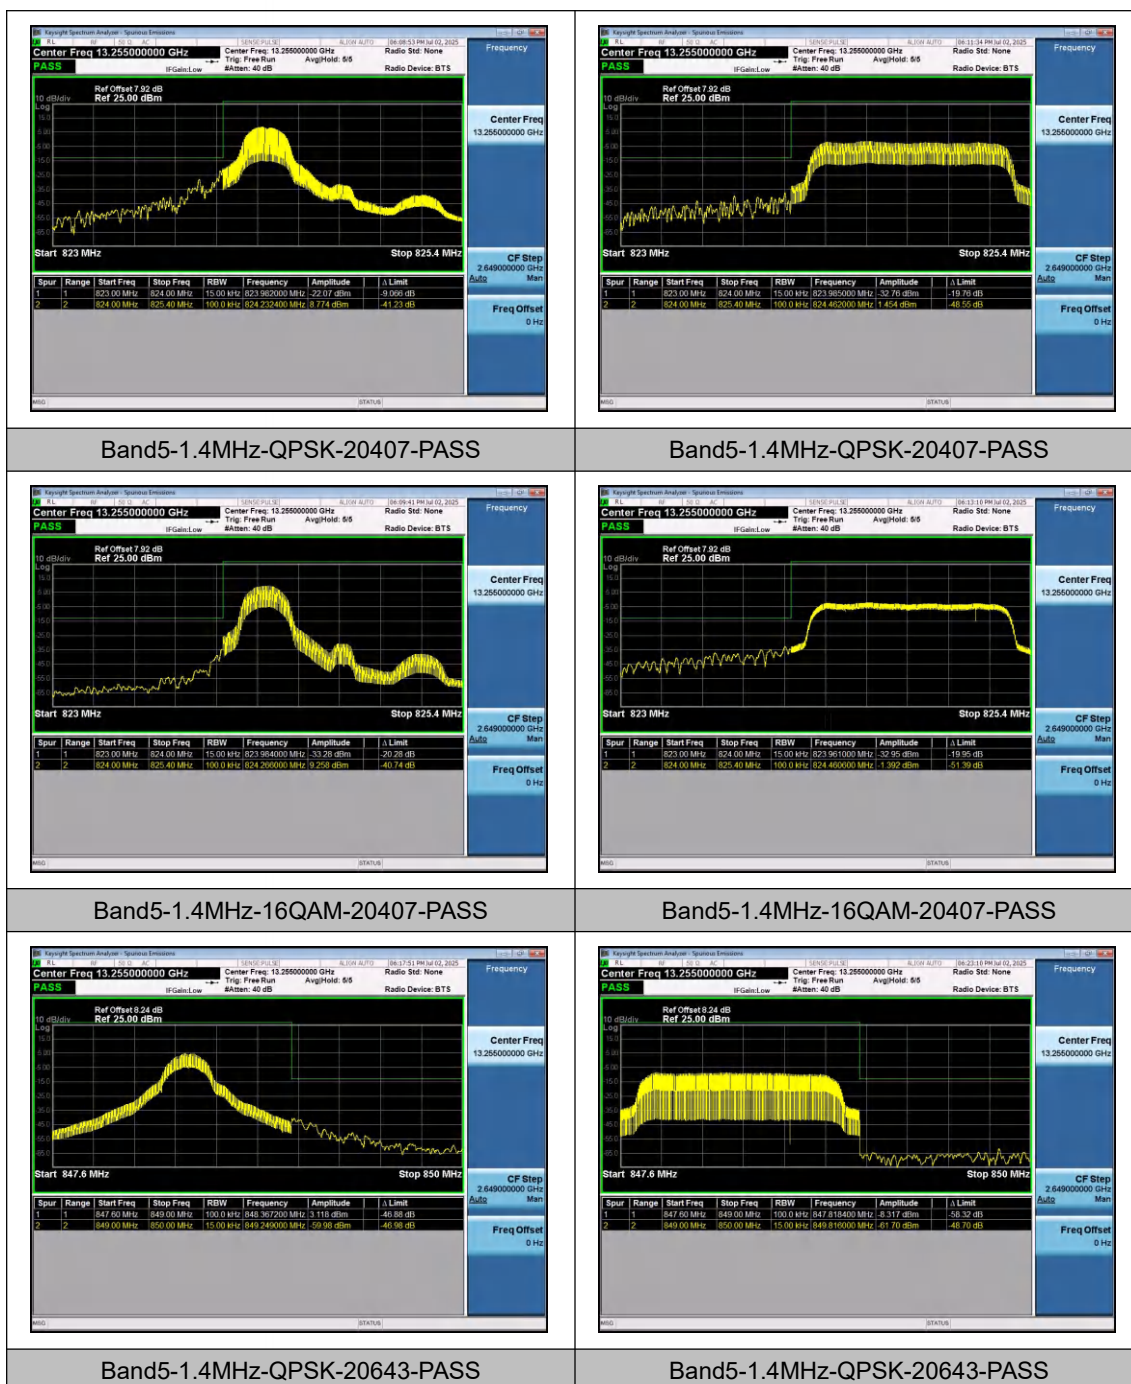

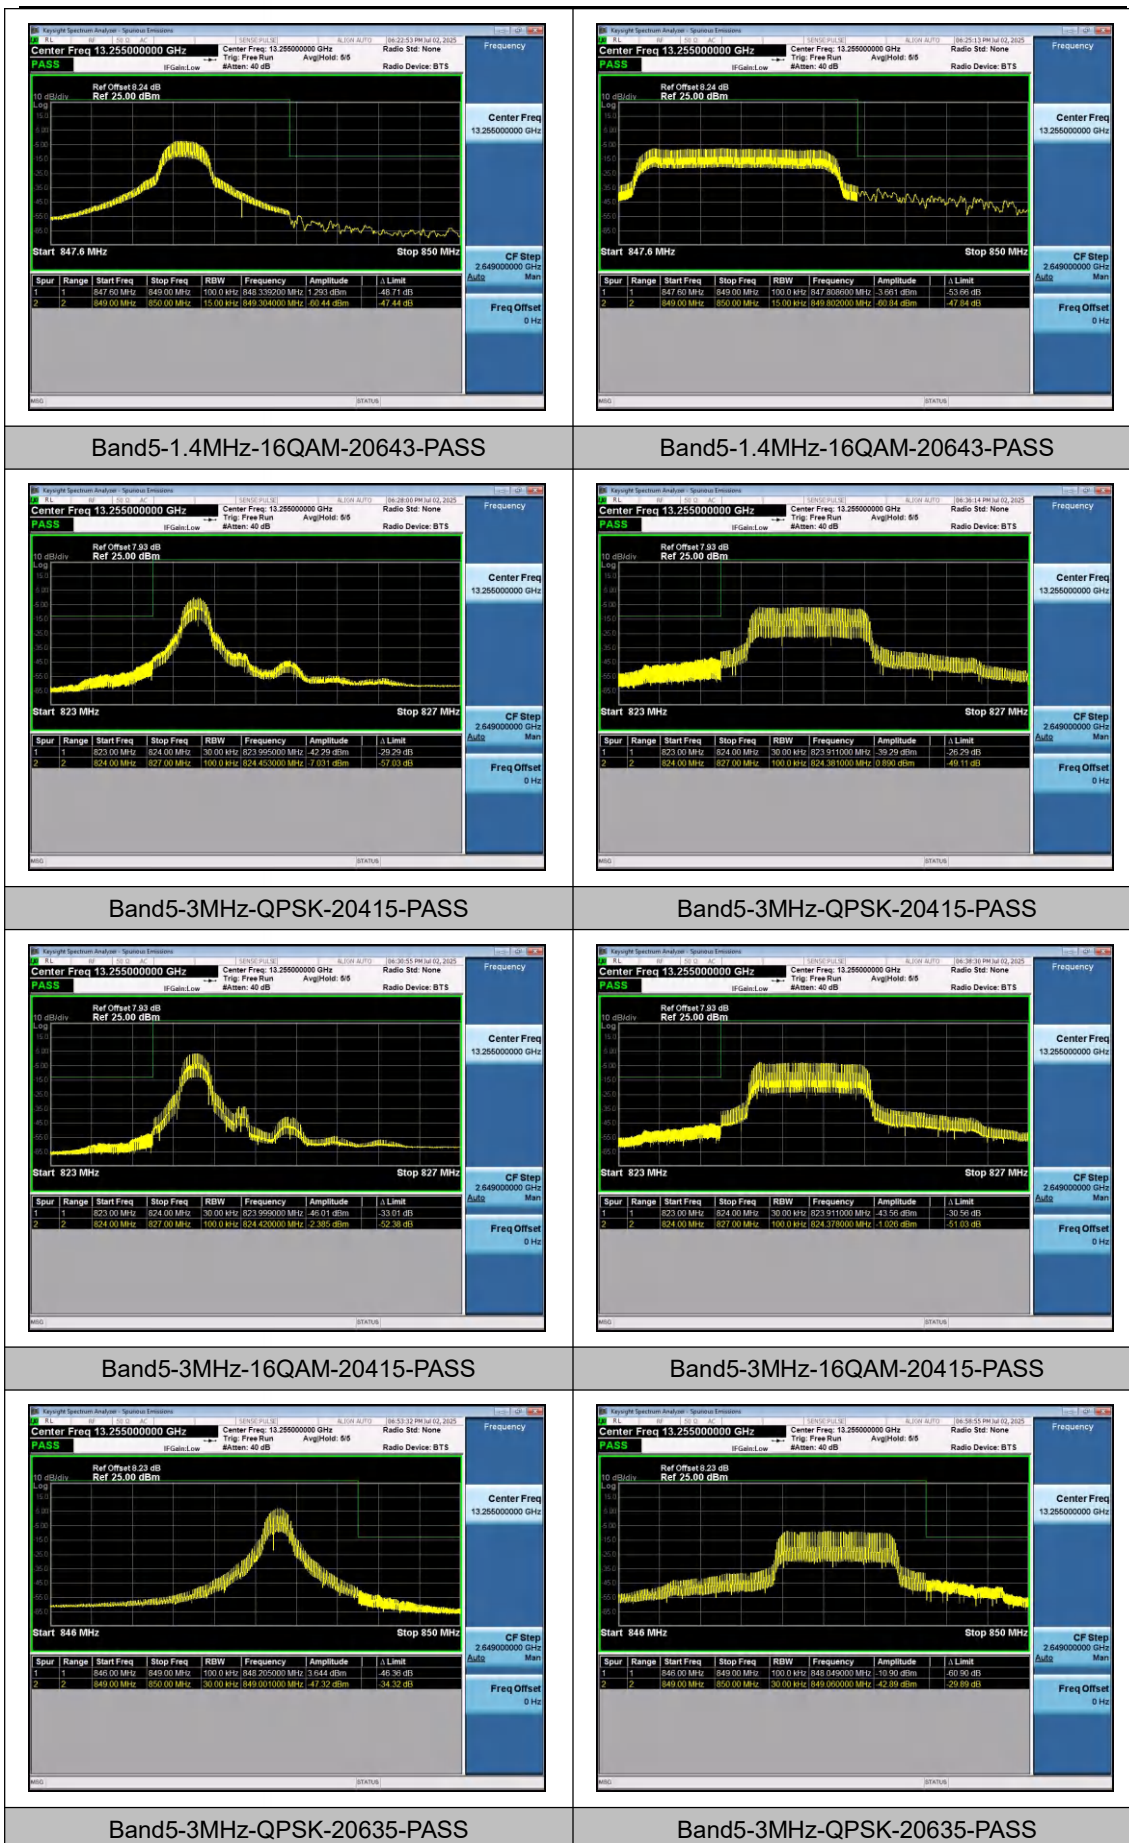

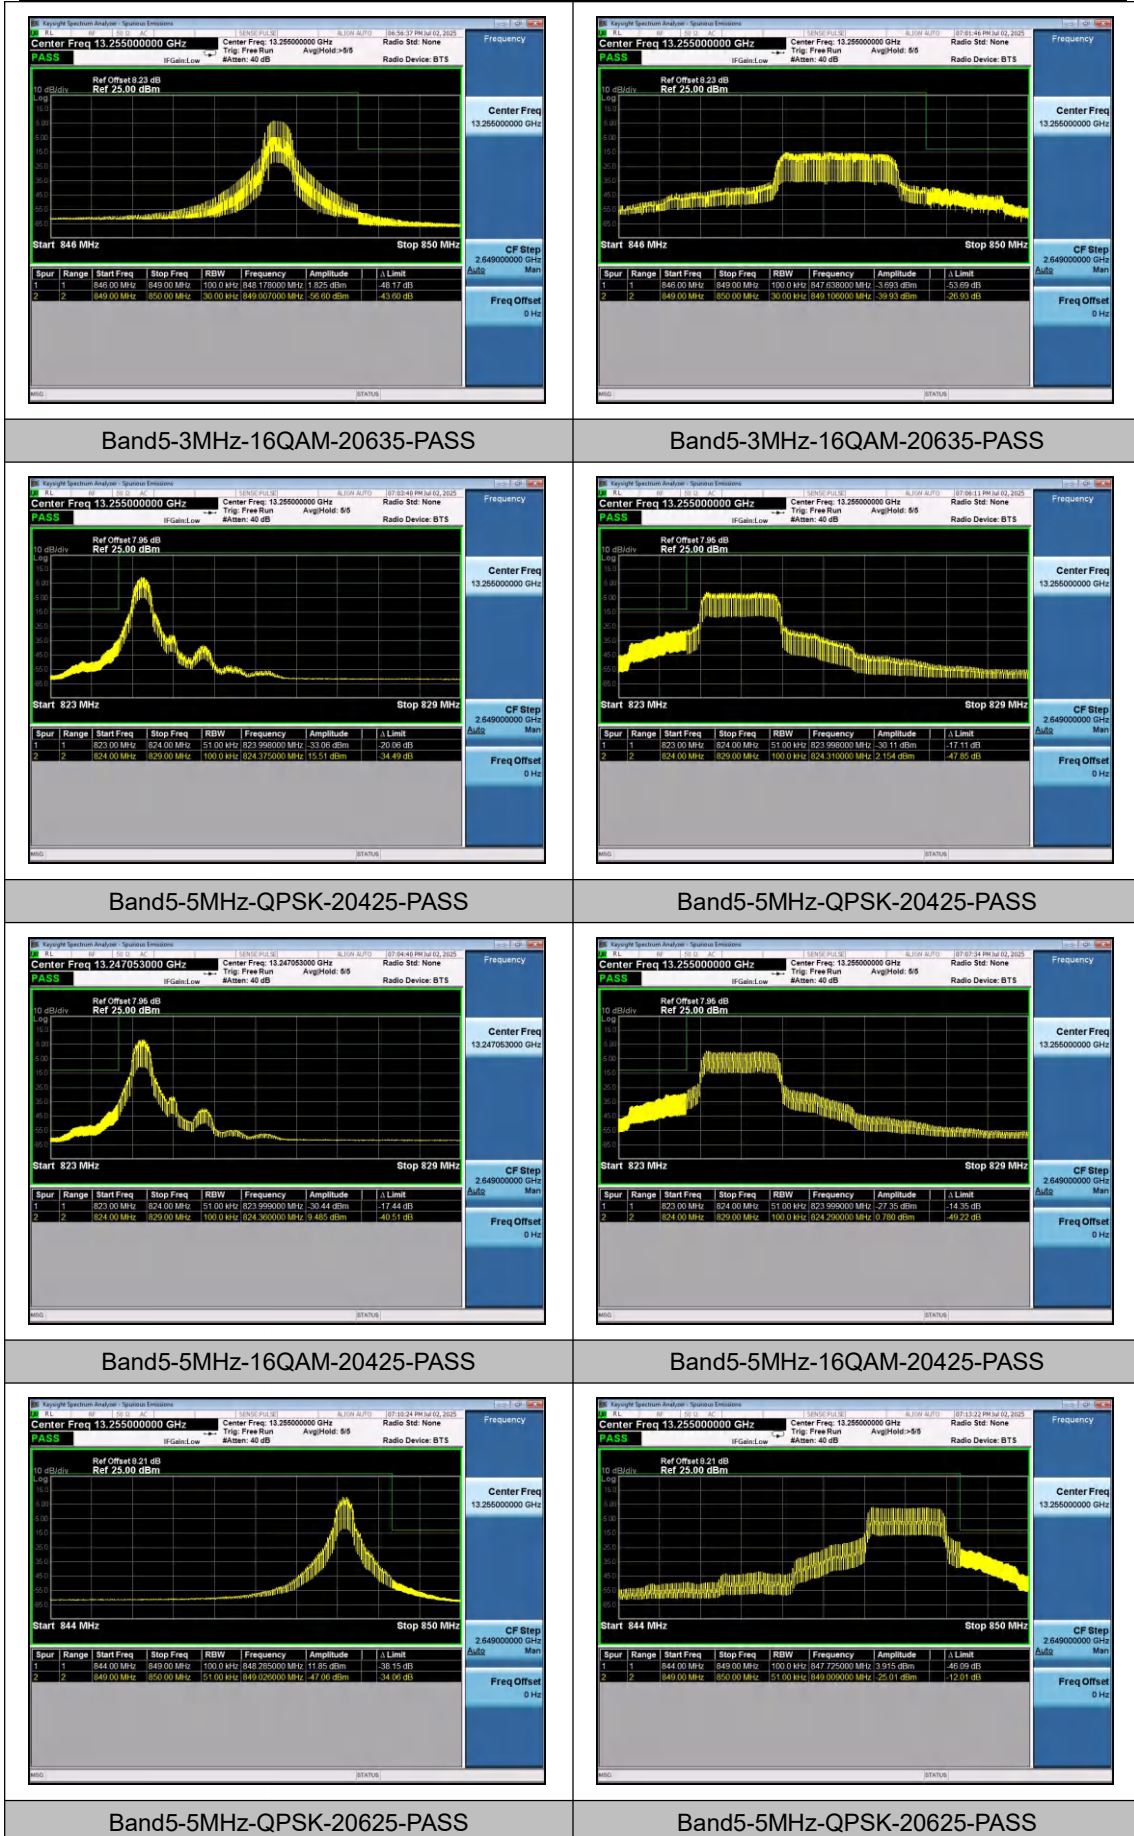

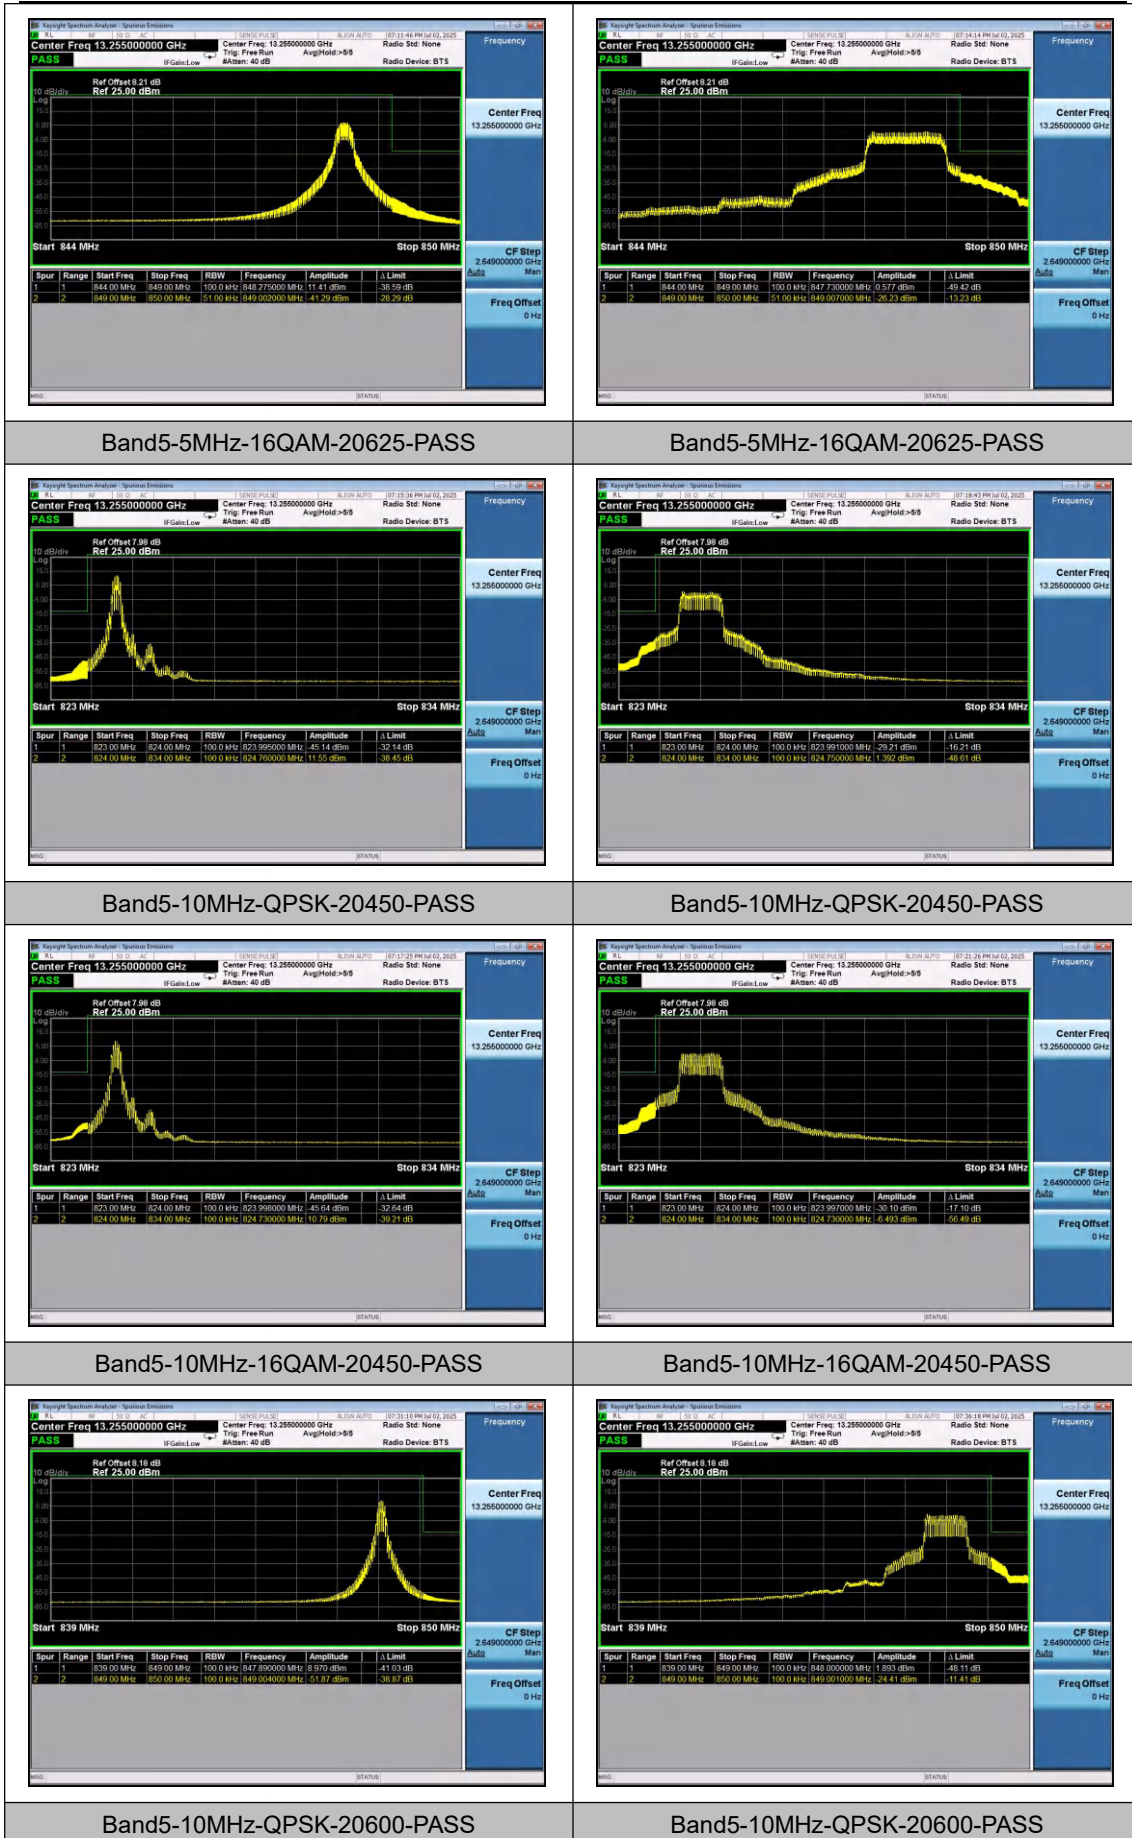

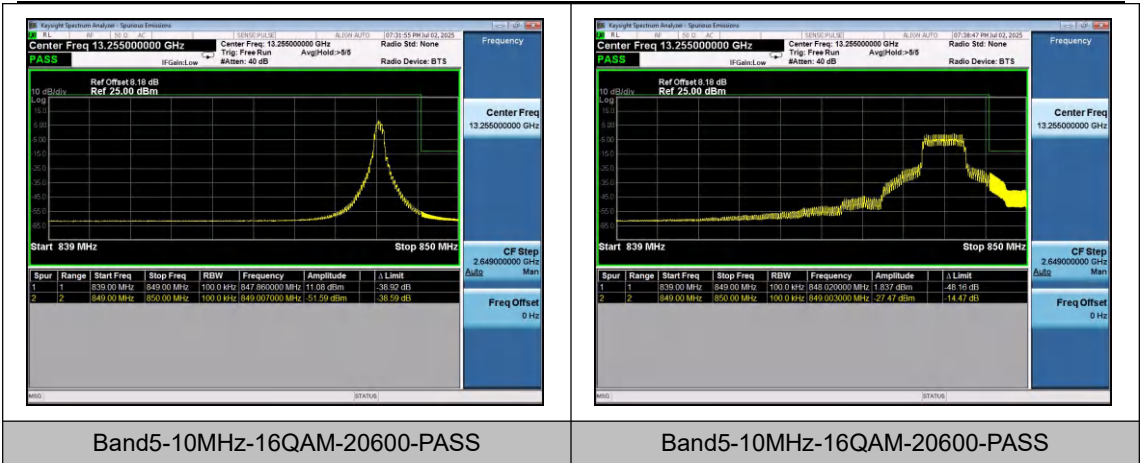

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band5	1.4MHz	QPSK	20407	1	0	Low	0.009	0.15	-73.85	PASS
Band5	1.4MHz	QPSK	20407	1	0	Low	0.15	30	-69.45	PASS
Band5	1.4MHz	QPSK	20407	1	0	Low	30	1000	-60.49	PASS
Band5	1.4MHz	QPSK	20407	1	0	Low	1000	10000	-48.18	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	0.009	0.15	-69.65	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	0.15	30	-74.77	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	30	1000	-61.77	PASS
Band5	1.4MHz	16QAM	20407	1	0	Low	1000	10000	-48.87	PASS
Band5	1.4MHz	QPSK	20525	1	0	Low	0.009	0.15	-76.24	PASS
Band5	1.4MHz	QPSK	20525	1	0	Low	0.15	30	-68.14	PASS
Band5	1.4MHz	QPSK	20525	1	0	Low	30	1000	-61.19	PASS
Band5	1.4MHz	QPSK	20525	1	0	Low	1000	10000	-48.38	PASS
Band5	1.4MHz	16QAM	20525	1	0	Low	0.009	0.15	-71.63	PASS
Band5	1.4MHz	16QAM	20525	1	0	Low	0.15	30	-70.64	PASS
Band5	1.4MHz	16QAM	20525	1	0	Low	30	1000	-61.37	PASS
Band5	1.4MHz	16QAM	20525	1	0	Low	1000	10000	-48.77	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	0.009	0.15	-75.2	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	0.15	30	-67.83	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	30	1000	-60.64	PASS
Band5	1.4MHz	QPSK	20643	1	5	High	1000	10000	-48.39	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	0.009	0.15	-71.5	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	0.15	30	-73	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	30	1000	-60.96	PASS
Band5	1.4MHz	16QAM	20643	1	5	High	1000	10000	-48.58	PASS
Band5	3MHz	QPSK	20415	1	0	Low	0.009	0.15	-75.03	PASS
Band5	3MHz	QPSK	20415	1	0	Low	0.15	30	-66.28	PASS
Band5	3MHz	QPSK	20415	1	0	Low	30	1000	-61.15	PASS
Band5	3MHz	QPSK	20415	1	0	Low	1000	10000	-48.4	PASS
Band5	3MHz	16QAM	20415	1	0	Low	0.009	0.15	-71.09	PASS
Band5	3MHz	16QAM	20415	1	0	Low	0.15	30	-68.92	PASS
Band5	3MHz	16QAM	20415	1	0	Low	30	1000	-61.34	PASS
Band5	3MHz	16QAM	20415	1	0	Low	1000	10000	-48.74	PASS
Band5	3MHz	QPSK	20525	1	0	Low	0.009	0.15	-74.99	PASS
Band5	3MHz	QPSK	20525	1	0	Low	0.15	30	-71.04	PASS
Band5	3MHz	QPSK	20525	1	0	Low	30	1000	-61.48	PASS
Band5	3MHz	QPSK	20525	1	0	Low	1000	10000	-48.4	PASS
Band5	3MHz	16QAM	20525	1	0	Low	0.009	0.15	-72	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band5	3MHz	16QAM	20525	1	0	Low	0.15	30	-74.16	PASS
Band5	3MHz	16QAM	20525	1	0	Low	30	1000	-61.6	PASS
Band5	3MHz	16QAM	20525	1	0	Low	1000	10000	-47.88	PASS
Band5	3MHz	QPSK	20635	1	5	High	0.009	0.15	-75.83	PASS
Band5	3MHz	QPSK	20635	1	5	High	0.15	30	-69.95	PASS
Band5	3MHz	QPSK	20635	1	5	High	30	1000	-61.18	PASS
Band5	3MHz	QPSK	20635	1	5	High	1000	10000	-48.35	PASS
Band5	3MHz	16QAM	20635	1	5	High	0.009	0.15	-70.9	PASS
Band5	3MHz	16QAM	20635	1	5	High	0.15	30	-72.05	PASS
Band5	3MHz	16QAM	20635	1	5	High	30	1000	-61.2	PASS
Band5	3MHz	16QAM	20635	1	5	High	1000	10000	-48.29	PASS
Band5	5MHz	QPSK	20425	1	0	Low	0.009	0.15	-74.63	PASS
Band5	5MHz	QPSK	20425	1	0	Low	0.15	30	-68.18	PASS
Band5	5MHz	QPSK	20425	1	0	Low	30	1000	-61.47	PASS
Band5	5MHz	QPSK	20425	1	0	Low	1000	10000	-48.48	PASS
Band5	5MHz	16QAM	20425	1	0	Low	0.009	0.15	-70.1	PASS
Band5	5MHz	16QAM	20425	1	0	Low	0.15	30	-67.07	PASS
Band5	5MHz	16QAM	20425	1	0	Low	30	1000	-61.2	PASS
Band5	5MHz	16QAM	20425	1	0	Low	1000	10000	-48.46	PASS
Band5	5MHz	QPSK	20525	1	0	Low	0.009	0.15	-74.71	PASS
Band5	5MHz	QPSK	20525	1	0	Low	0.15	30	-65.73	PASS
Band5	5MHz	QPSK	20525	1	0	Low	30	1000	-60.83	PASS
Band5	5MHz	QPSK	20525	1	0	Low	1000	10000	-48.64	PASS
Band5	5MHz	16QAM	20525	1	0	Low	0.009	0.15	-69.38	PASS
Band5	5MHz	16QAM	20525	1	0	Low	0.15	30	-70.69	PASS
Band5	5MHz	16QAM	20525	1	0	Low	30	1000	-61.53	PASS
Band5	5MHz	16QAM	20525	1	0	Low	1000	10000	-48.63	PASS
Band5	5MHz	QPSK	20625	1	5	High	0.009	0.15	-75.45	PASS
Band5	5MHz	QPSK	20625	1	5	High	0.15	30	-65.89	PASS
Band5	5MHz	QPSK	20625	1	5	High	30	1000	-60.99	PASS
Band5	5MHz	QPSK	20625	1	5	High	1000	10000	-48.36	PASS
Band5	5MHz	16QAM	20625	1	5	High	0.009	0.15	-70.58	PASS
Band5	5MHz	16QAM	20625	1	5	High	0.15	30	-68.55	PASS
Band5	5MHz	16QAM	20625	1	5	High	30	1000	-61.17	PASS
Band5	5MHz	16QAM	20625	1	5	High	1000	10000	-48.49	PASS
Band5	10MHz	QPSK	20450	1	0	Low	0.009	0.15	-74.21	PASS
Band5	10MHz	QPSK	20450	1	0	Low	0.15	30	-65.73	PASS
Band5	10MHz	QPSK	20450	1	0	Low	30	1000	-61.71	PASS
Band5	10MHz	QPSK	20450	1	0	Low	1000	10000	-48.27	PASS
Band5	10MHz	16QAM	20450	1	0	Low	0.009	0.15	-68.28	PASS
Band5	10MHz	16QAM	20450	1	0	Low	0.15	30	-71.1	PASS
Band5	10MHz	16QAM	20450	1	0	Low	30	1000	-61.27	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band5	10MHz	16QAM	20450	1	0	Low	1000	10000	-48.61	PASS
Band5	10MHz	QPSK	20525	1	0	Low	0.009	0.15	-75.78	PASS
Band5	10MHz	QPSK	20525	1	0	Low	0.15	30	-71	PASS
Band5	10MHz	QPSK	20525	1	0	Low	30	1000	-61.01	PASS
Band5	10MHz	QPSK	20525	1	0	Low	1000	10000	-48.59	PASS
Band5	10MHz	16QAM	20525	1	0	Low	0.009	0.15	-69.17	PASS
Band5	10MHz	16QAM	20525	1	0	Low	0.15	30	-71.24	PASS
Band5	10MHz	16QAM	20525	1	0	Low	30	1000	-61.34	PASS
Band5	10MHz	16QAM	20525	1	0	Low	1000	10000	-48.44	PASS
Band5	10MHz	QPSK	20600	1	5	High	0.009	0.15	-75.8	PASS
Band5	10MHz	QPSK	20600	1	5	High	0.15	30	-70.91	PASS
Band5	10MHz	QPSK	20600	1	5	High	30	1000	-61.12	PASS
Band5	10MHz	QPSK	20600	1	5	High	1000	10000	-48.6	PASS
Band5	10MHz	16QAM	20600	1	5	High	0.009	0.15	-69.02	PASS
Band5	10MHz	16QAM	20600	1	5	High	0.15	30	-71.36	PASS
Band5	10MHz	16QAM	20600	1	5	High	30	1000	-61.11	PASS
Band5	10MHz	16QAM	20600	1	5	High	1000	10000	-48.62	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Test Graphs

