

Appendix Test Data

Report No:	1816C50010012503	Test Sample NO:	1-2-2
Start Test Date:	2025-06-27	Finish Test Date:	2025-07-2
Test Engineer:	<i>Joker Huang</i>	Auditor:	<i>Justin Feng</i>
Temperature:	24.3°C	Relative Humidity:	56%
Pressure:	101 kPa		

Appendix A: Conducted Output Power for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Conducted Power(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1	0	Low	22.92	PASS
Band66	1.4MHz	QPSK	131979	1	5	Low	22.73	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	20.72	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	22.03	PASS
Band66	1.4MHz	16QAM	131979	1	5	Low	21.76	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	20.53	PASS
Band66	1.4MHz	QPSK	132322	1	0	Low	22.94	PASS
Band66	1.4MHz	QPSK	132322	1	5	Low	22.76	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	20.87	PASS
Band66	1.4MHz	16QAM	132322	1	0	Low	21.72	PASS
Band66	1.4MHz	16QAM	132322	1	5	Low	21.61	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	20.86	PASS
Band66	1.4MHz	QPSK	132665	1	0	High	22.50	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	22.62	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	21.19	PASS
Band66	1.4MHz	16QAM	132665	1	0	High	21.85	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	21.81	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	21.19	PASS
Band66	3MHz	QPSK	131987	1	0	Low	22.82	PASS
Band66	3MHz	QPSK	131987	1	5	Low	22.64	PASS
Band66	3MHz	QPSK	131987	6	0	Low	20.54	PASS
Band66	3MHz	16QAM	131987	1	0	Low	21.48	PASS
Band66	3MHz	16QAM	131987	1	5	Low	21.22	PASS
Band66	3MHz	16QAM	131987	6	0	Low	20.64	PASS
Band66	3MHz	QPSK	132322	1	0	Low	22.99	PASS
Band66	3MHz	QPSK	132322	1	5	Low	22.86	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	QPSK	132322	6	0	Low	20.85	PASS
Band66	3MHz	16QAM	132322	1	0	Low	21.87	PASS
Band66	3MHz	16QAM	132322	1	5	Low	21.60	PASS
Band66	3MHz	16QAM	132322	6	0	Low	20.92	PASS
Band66	3MHz	QPSK	132657	1	0	High	22.57	PASS
Band66	3MHz	QPSK	132657	1	5	High	22.58	PASS
Band66	3MHz	QPSK	132657	6	0	High	21.25	PASS
Band66	3MHz	16QAM	132657	1	0	High	21.66	PASS
Band66	3MHz	16QAM	132657	1	5	High	21.63	PASS
Band66	3MHz	16QAM	132657	6	0	High	21.25	PASS
Band66	5MHz	QPSK	131997	1	0	Low	22.73	PASS
Band66	5MHz	QPSK	131997	1	5	Low	22.62	PASS
Band66	5MHz	QPSK	131997	6	0	Low	21.62	PASS
Band66	5MHz	16QAM	131997	1	0	Low	22.38	PASS
Band66	5MHz	16QAM	131997	1	5	Low	22.25	PASS
Band66	5MHz	16QAM	131997	6	0	Low	21.70	PASS
Band66	5MHz	QPSK	132322	1	0	Low	23.03	PASS
Band66	5MHz	QPSK	132322	1	5	Low	23.02	PASS
Band66	5MHz	QPSK	132322	6	0	Low	22.06	PASS
Band66	5MHz	16QAM	132322	1	0	Low	22.78	PASS
Band66	5MHz	16QAM	132322	1	5	Low	22.72	PASS
Band66	5MHz	16QAM	132322	6	0	Low	22.06	PASS
Band66	5MHz	QPSK	132647	1	0	High	22.76	PASS
Band66	5MHz	QPSK	132647	1	5	High	21.98	PASS
Band66	5MHz	QPSK	132647	6	0	High	22.14	PASS
Band66	5MHz	16QAM	132647	1	0	High	21.12	PASS
Band66	5MHz	16QAM	132647	1	5	High	21.09	PASS
Band66	5MHz	16QAM	132647	6	0	High	22.14	PASS
Band66	10MHz	QPSK	132022	1	0	Low	22.59	PASS
Band66	10MHz	QPSK	132022	1	5	Low	22.68	PASS
Band66	10MHz	QPSK	132022	6	0	Low	21.69	PASS
Band66	10MHz	16QAM	132022	1	0	Low	22.31	PASS
Band66	10MHz	16QAM	132022	1	5	Low	22.28	PASS
Band66	10MHz	16QAM	132022	6	0	Low	21.53	PASS
Band66	10MHz	QPSK	132322	1	0	Low	22.93	PASS
Band66	10MHz	QPSK	132322	1	5	Low	22.97	PASS
Band66	10MHz	QPSK	132322	6	0	Low	21.92	PASS
Band66	10MHz	16QAM	132322	1	0	Low	22.59	PASS
Band66	10MHz	16QAM	132322	1	5	Low	22.48	PASS
Band66	10MHz	16QAM	132322	6	0	Low	21.85	PASS
Band66	10MHz	QPSK	132622	1	0	High	22.80	PASS
Band66	10MHz	QPSK	132622	1	5	High	22.78	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	QPSK	132622	6	0	High	22.16	PASS
Band66	10MHz	16QAM	132622	1	0	High	22.12	PASS
Band66	10MHz	16QAM	132622	1	5	High	22.07	PASS
Band66	10MHz	16QAM	132622	6	0	High	22.16	PASS
Band66	15MHz	QPSK	132047	1	0	Low	22.69	PASS
Band66	15MHz	QPSK	132047	1	5	Low	22.60	PASS
Band66	15MHz	QPSK	132047	6	0	Low	22.52	PASS
Band66	15MHz	16QAM	132047	1	0	Low	22.38	PASS
Band66	15MHz	16QAM	132047	1	5	Low	22.17	PASS
Band66	15MHz	16QAM	132047	6	0	Low	22.56	PASS
Band66	15MHz	QPSK	132322	1	0	Low	22.88	PASS
Band66	15MHz	QPSK	132322	1	5	Low	22.98	PASS
Band66	15MHz	QPSK	132322	6	0	Low	22.74	PASS
Band66	15MHz	16QAM	132322	1	0	Low	22.54	PASS
Band66	15MHz	16QAM	132322	1	5	Low	22.49	PASS
Band66	15MHz	16QAM	132322	6	0	Low	22.83	PASS
Band66	15MHz	QPSK	132597	1	0	High	22.74	PASS
Band66	15MHz	QPSK	132597	1	5	High	22.74	PASS
Band66	15MHz	QPSK	132597	6	0	High	22.61	PASS
Band66	15MHz	16QAM	132597	1	0	High	22.06	PASS
Band66	15MHz	16QAM	132597	1	5	High	22.28	PASS
Band66	15MHz	16QAM	132597	6	0	High	22.61	PASS
Band66	20MHz	QPSK	132072	1	0	Low	22.65	PASS
Band66	20MHz	QPSK	132072	1	5	Low	22.62	PASS
Band66	20MHz	QPSK	132072	6	0	Low	22.47	PASS
Band66	20MHz	16QAM	132072	1	0	Low	22.32	PASS
Band66	20MHz	16QAM	132072	1	5	Low	22.24	PASS
Band66	20MHz	16QAM	132072	6	0	Low	22.59	PASS
Band66	20MHz	QPSK	132322	1	0	Low	22.82	PASS
Band66	20MHz	QPSK	132322	1	5	Low	22.76	PASS
Band66	20MHz	QPSK	132322	6	0	Low	22.65	PASS
Band66	20MHz	16QAM	132322	1	0	Low	22.48	PASS
Band66	20MHz	16QAM	132322	1	5	Low	22.42	PASS
Band66	20MHz	16QAM	132322	6	0	Low	22.81	PASS
Band66	20MHz	QPSK	132572	1	0	High	22.76	PASS
Band66	20MHz	QPSK	132572	1	5	High	22.77	PASS
Band66	20MHz	QPSK	132572	6	0	High	22.64	PASS
Band66	20MHz	16QAM	132572	1	0	High	21.95	PASS
Band66	20MHz	16QAM	132572	1	5	High	22.29	PASS
Band66	20MHz	16QAM	132572	6	0	High	22.65	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix B: Peak-to-Average Ratio(CCDF) for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NBIndex	Result(dB)	Limit(dB)	Verdict
Band66	1.4MHz	QPSK	131979	1	0	Low	1.84	<=13	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	4.26	<=13	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	3.15	<=13	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	4.27	<=13	PASS
Band66	1.4MHz	QPSK	132322	1	0	Low	1.40	<=13	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	3.83	<=13	PASS
Band66	1.4MHz	16QAM	132322	1	0	Low	2.46	<=13	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	3.82	<=13	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	1.19	<=13	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	3.41	<=13	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	1.99	<=13	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	3.40	<=13	PASS
Band66	3MHz	QPSK	131987	1	0	Low	1.82	<=13	PASS
Band66	3MHz	QPSK	131987	6	0	Low	3.89	<=13	PASS
Band66	3MHz	16QAM	131987	1	0	Low	3.08	<=13	PASS
Band66	3MHz	16QAM	131987	6	0	Low	3.89	<=13	PASS
Band66	3MHz	QPSK	132322	1	0	Low	1.30	<=13	PASS
Band66	3MHz	QPSK	132322	6	0	Low	3.27	<=13	PASS
Band66	3MHz	16QAM	132322	1	0	Low	2.41	<=13	PASS
Band66	3MHz	16QAM	132322	6	0	Low	3.26	<=13	PASS
Band66	3MHz	QPSK	132657	1	5	High	1.16	<=13	PASS
Band66	3MHz	QPSK	132657	6	0	High	2.58	<=13	PASS
Band66	3MHz	16QAM	132657	1	5	High	1.96	<=13	PASS
Band66	3MHz	16QAM	132657	6	0	High	2.58	<=13	PASS
Band66	5MHz	QPSK	131997	1	0	Low	2.80	<=13	PASS
Band66	5MHz	QPSK	131997	6	0	Low	3.98	<=13	PASS
Band66	5MHz	16QAM	131997	1	0	Low	2.41	<=13	PASS
Band66	5MHz	16QAM	131997	6	0	Low	3.93	<=13	PASS
Band66	5MHz	QPSK	132322	1	0	Low	2.17	<=13	PASS
Band66	5MHz	QPSK	132322	6	0	Low	3.38	<=13	PASS
Band66	5MHz	16QAM	132322	1	0	Low	1.81	<=13	PASS
Band66	5MHz	16QAM	132322	6	0	Low	3.39	<=13	PASS
Band66	5MHz	QPSK	132647	1	5	High	1.15	<=13	PASS
Band66	5MHz	QPSK	132647	6	0	High	2.59	<=13	PASS
Band66	5MHz	16QAM	132647	1	5	High	1.45	<=13	PASS
Band66	5MHz	16QAM	132647	6	0	High	2.60	<=13	PASS
Band66	10MHz	QPSK	132022	1	0	Low	1.94	<=13	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band66	10MHz	QPSK	132022	6	0	Low	2.98	<=13	PASS
Band66	10MHz	16QAM	132022	1	0	Low	2.43	<=13	PASS
Band66	10MHz	16QAM	132022	6	0	Low	3.01	<=13	PASS
Band66	10MHz	QPSK	132322	1	0	Low	1.45	<=13	PASS
Band66	10MHz	QPSK	132322	6	0	Low	2.48	<=13	PASS
Band66	10MHz	16QAM	132322	1	0	Low	1.84	<=13	PASS
Band66	10MHz	16QAM	132322	6	0	Low	2.48	<=13	PASS
Band66	10MHz	QPSK	132622	1	5	High	1.09	<=13	PASS
Band66	10MHz	QPSK	132622	6	0	High	1.93	<=13	PASS
Band66	10MHz	16QAM	132622	1	5	High	1.45	<=13	PASS
Band66	10MHz	16QAM	132622	6	0	High	1.93	<=13	PASS
Band66	15MHz	QPSK	132047	1	0	Low	1.90	<=13	PASS
Band66	15MHz	QPSK	132047	6	0	Low	2.19	<=13	PASS
Band66	15MHz	16QAM	132047	1	0	Low	2.34	<=13	PASS
Band66	15MHz	16QAM	132047	6	0	Low	2.20	<=13	PASS
Band66	15MHz	QPSK	132322	1	0	Low	1.43	<=13	PASS
Band66	15MHz	QPSK	132322	6	0	Low	1.77	<=13	PASS
Band66	15MHz	16QAM	132322	1	0	Low	1.95	<=13	PASS
Band66	15MHz	16QAM	132322	6	0	Low	1.77	<=13	PASS
Band66	15MHz	QPSK	132597	1	5	High	1.13	<=13	PASS
Band66	15MHz	QPSK	132597	6	0	High	1.49	<=13	PASS
Band66	15MHz	16QAM	132597	1	5	High	1.45	<=13	PASS
Band66	15MHz	16QAM	132597	6	0	High	1.49	<=13	PASS
Band66	20MHz	QPSK	132072	1	0	Low	1.91	<=13	PASS
Band66	20MHz	QPSK	132072	6	0	Low	2.18	<=13	PASS
Band66	20MHz	16QAM	132072	1	0	Low	2.46	<=13	PASS
Band66	20MHz	16QAM	132072	6	0	Low	2.19	<=13	PASS
Band66	20MHz	QPSK	132322	1	0	Low	1.65	<=13	PASS
Band66	20MHz	QPSK	132322	6	0	Low	1.79	<=13	PASS
Band66	20MHz	16QAM	132322	1	0	Low	2.03	<=13	PASS
Band66	20MHz	16QAM	132322	6	0	Low	1.80	<=13	PASS
Band66	20MHz	QPSK	132572	1	5	High	1.17	<=13	PASS
Band66	20MHz	QPSK	132572	6	0	High	1.51	<=13	PASS
Band66	20MHz	16QAM	132572	1	5	High	1.46	<=13	PASS
Band66	20MHz	16QAM	132572	6	0	High	1.51	<=13	PASS


Test Graphs

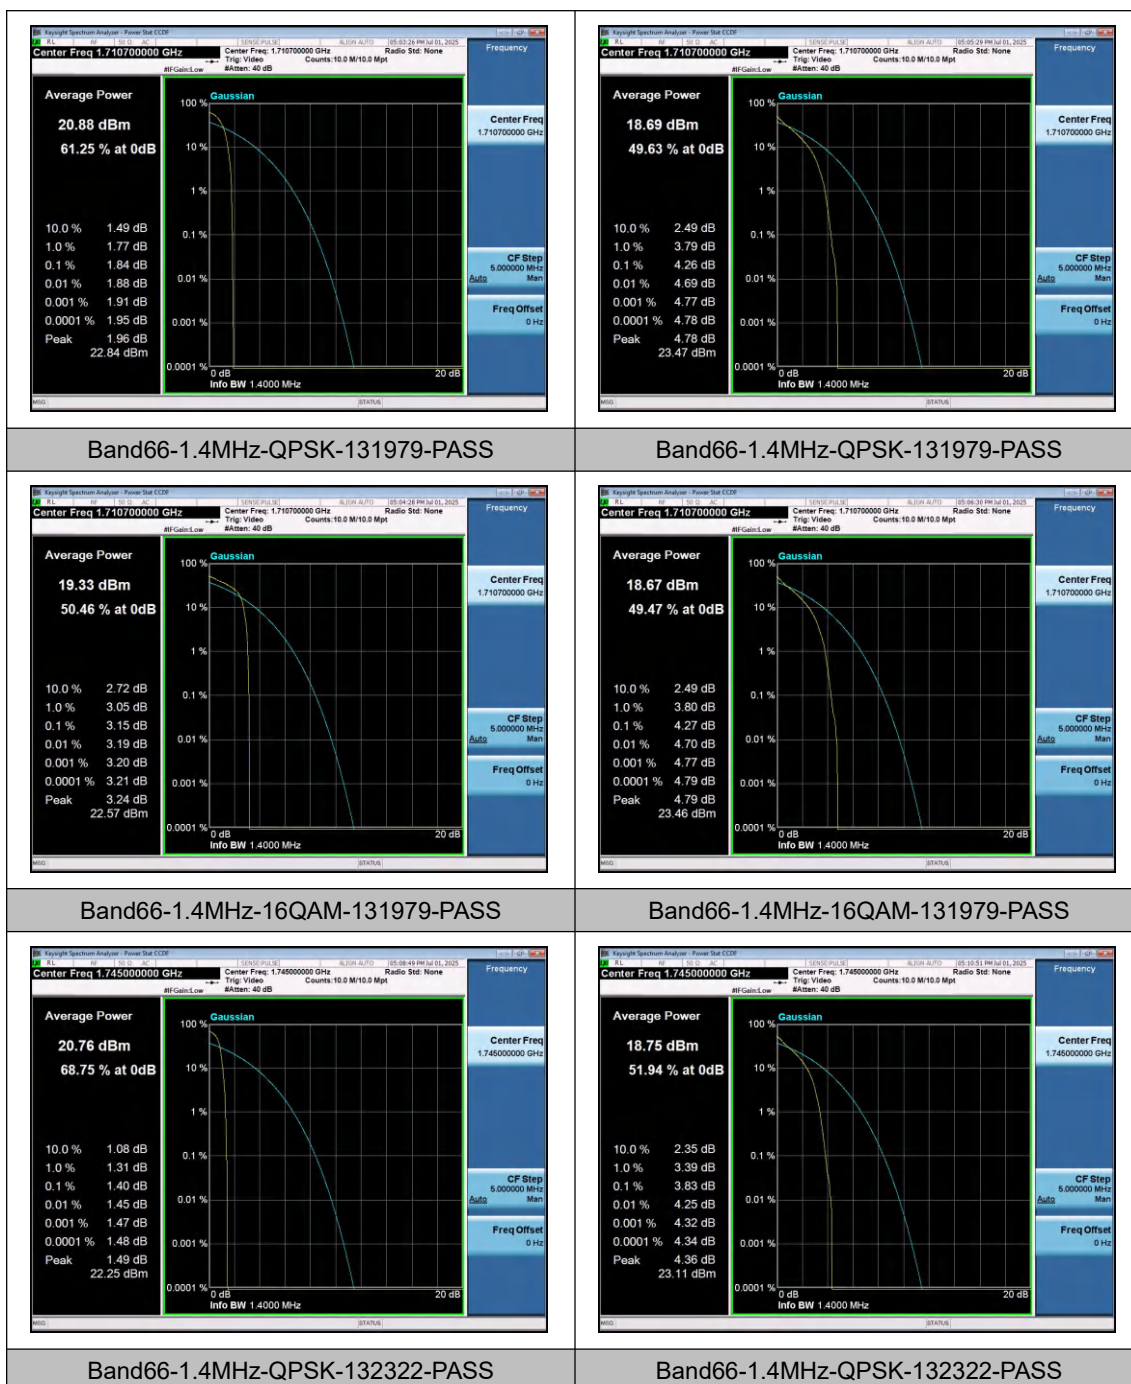


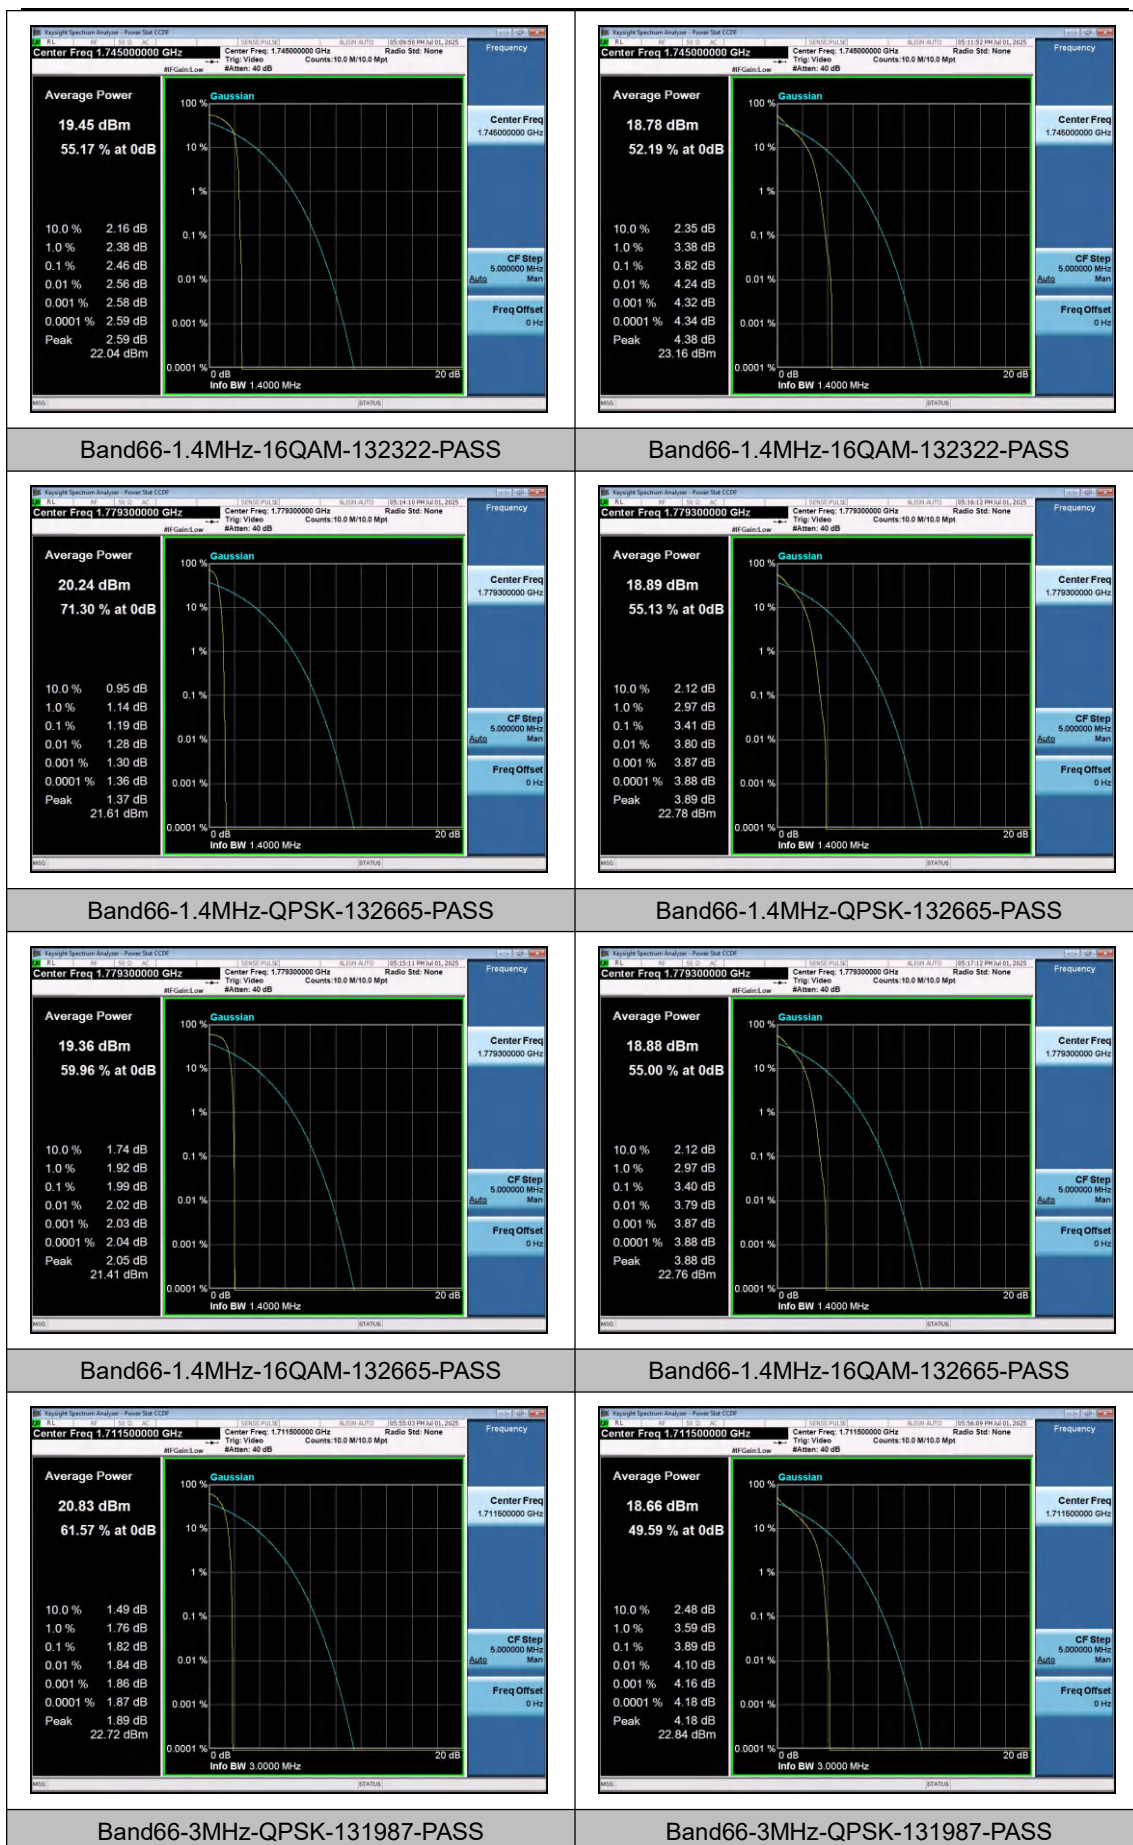


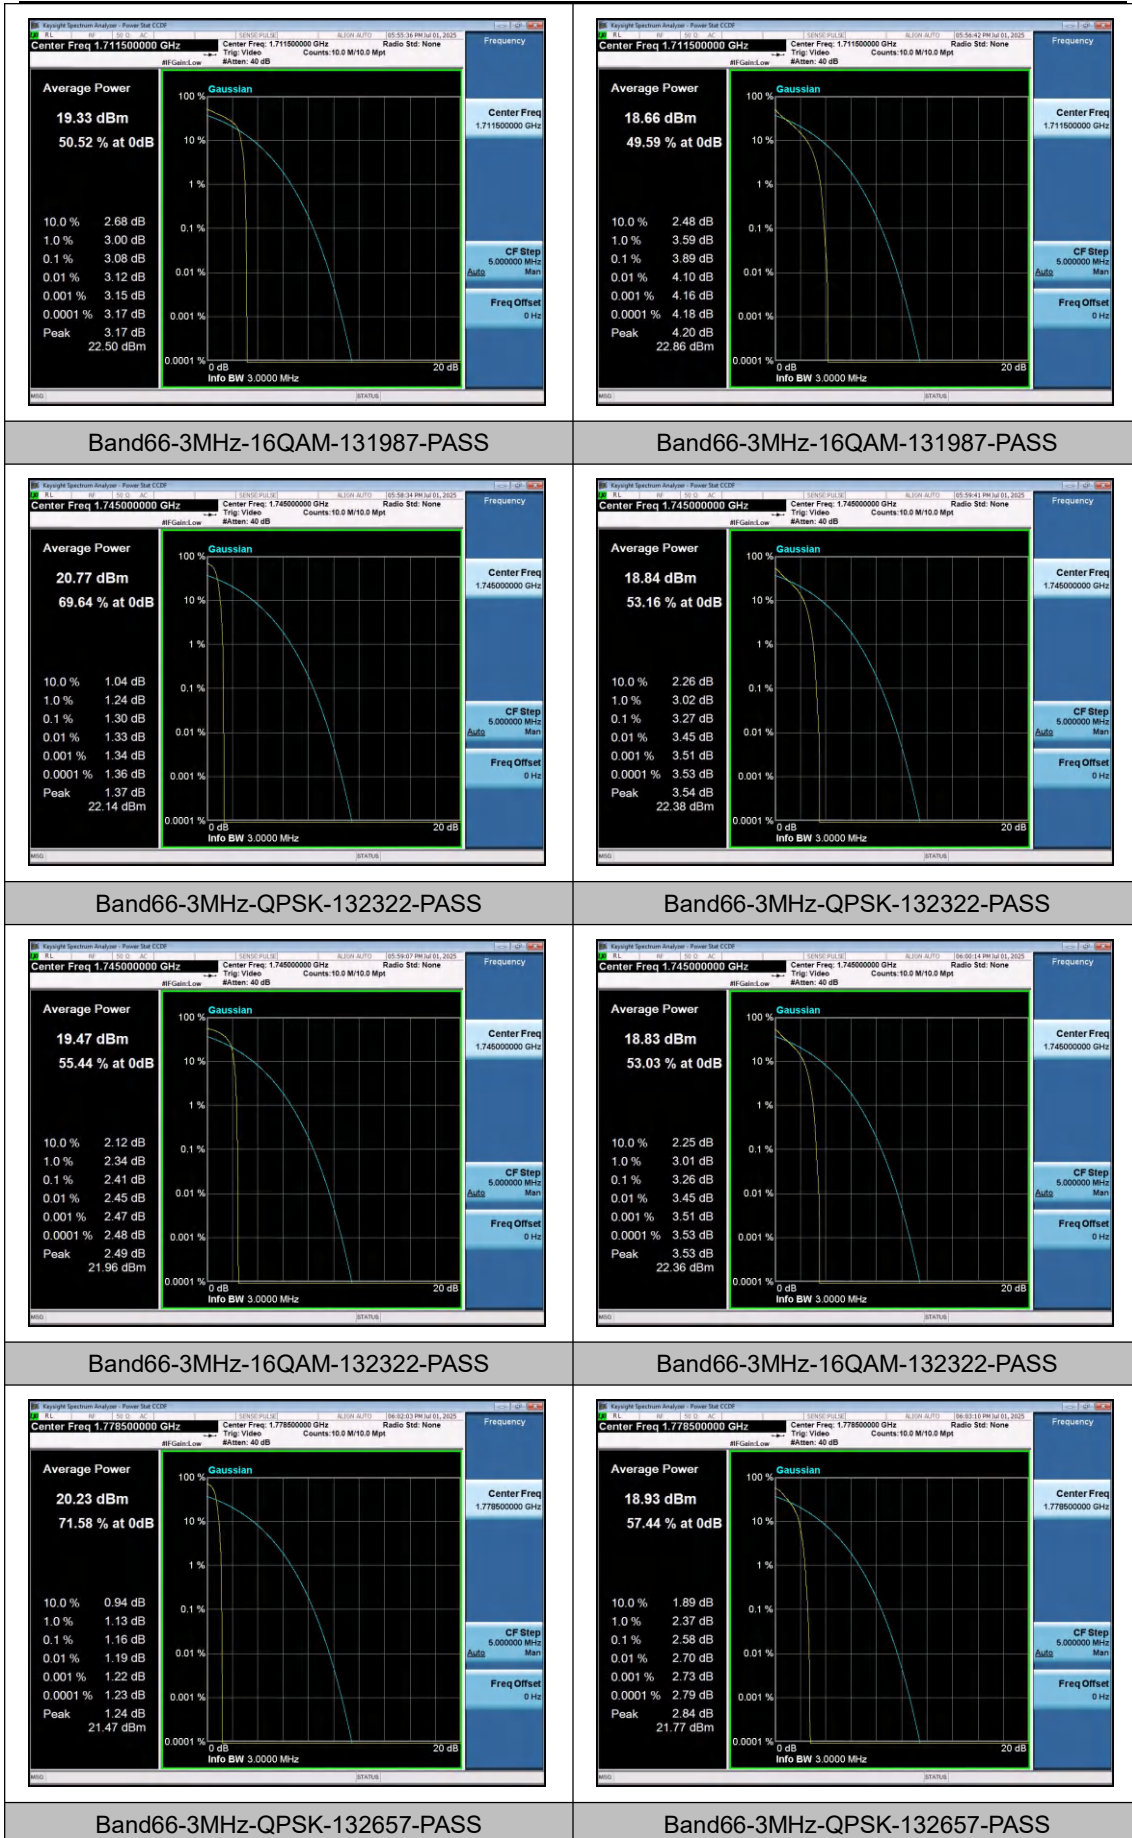

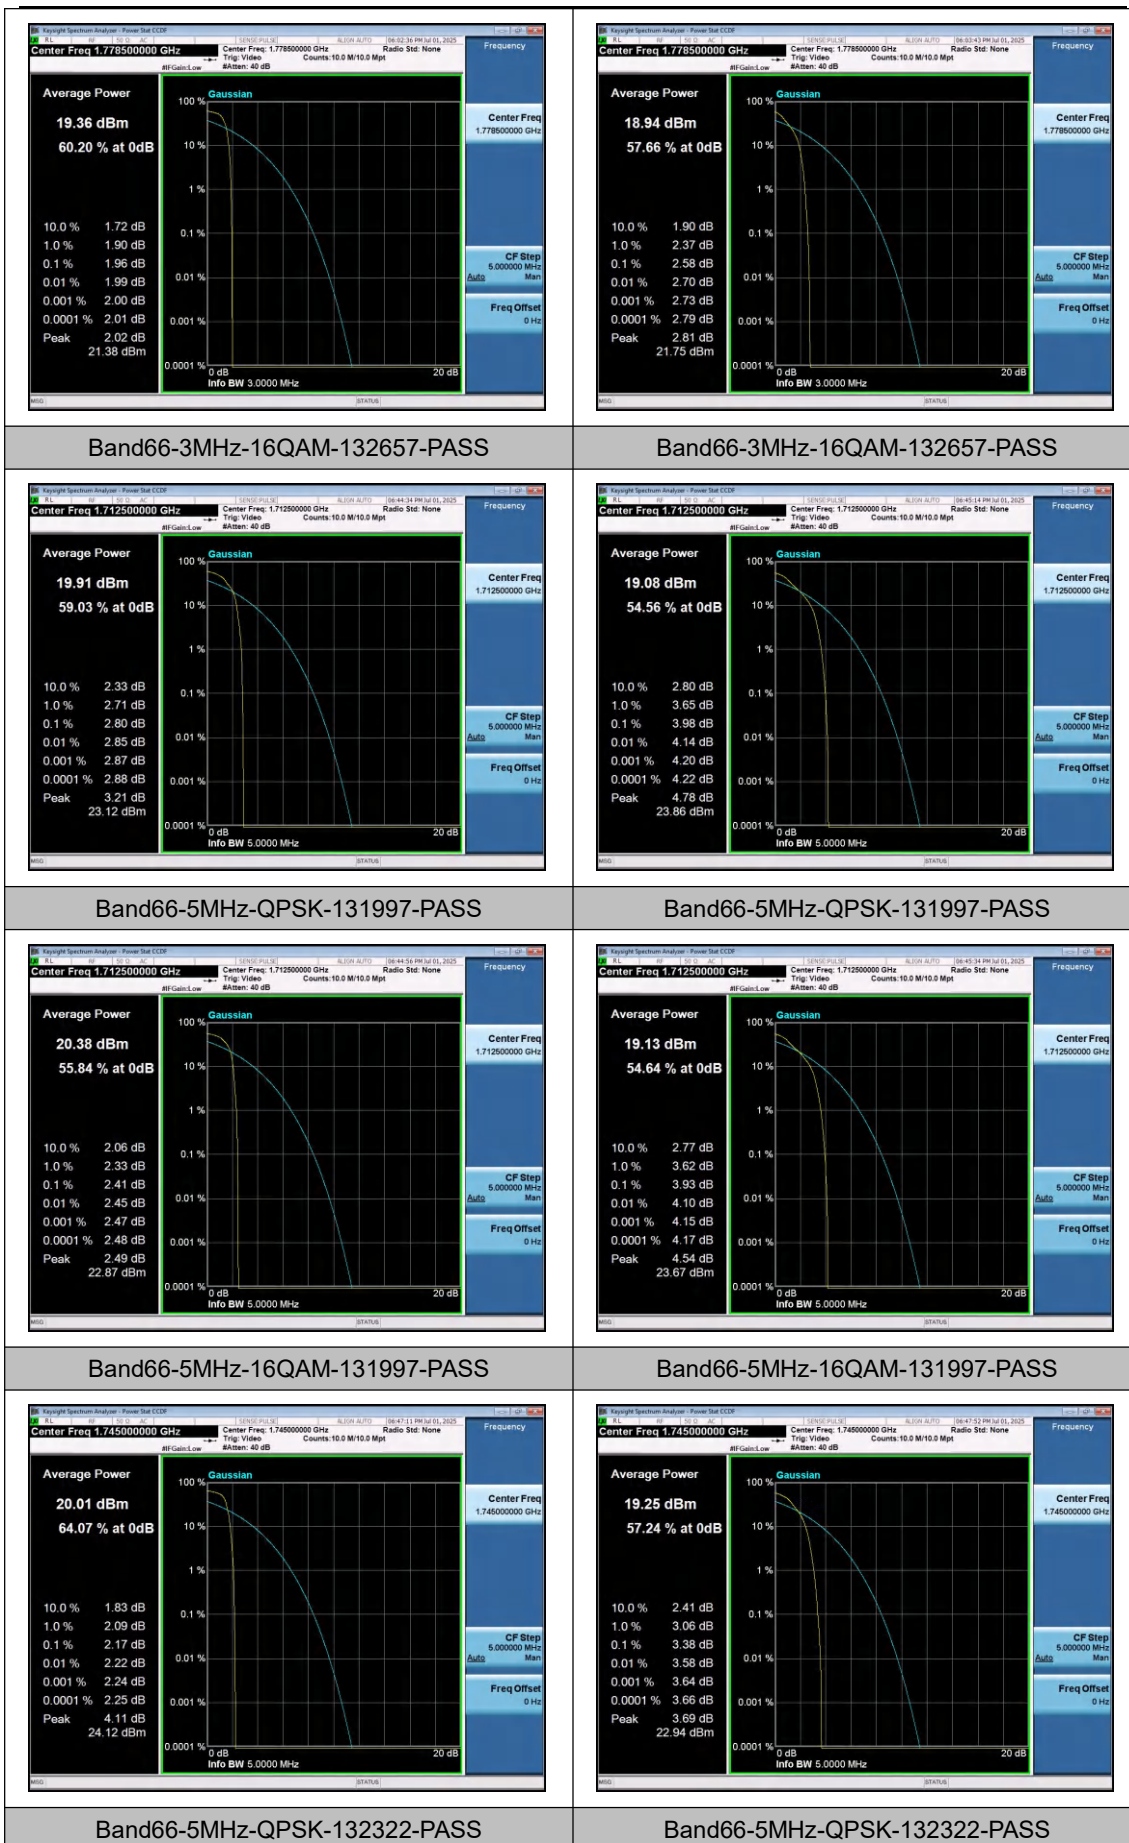


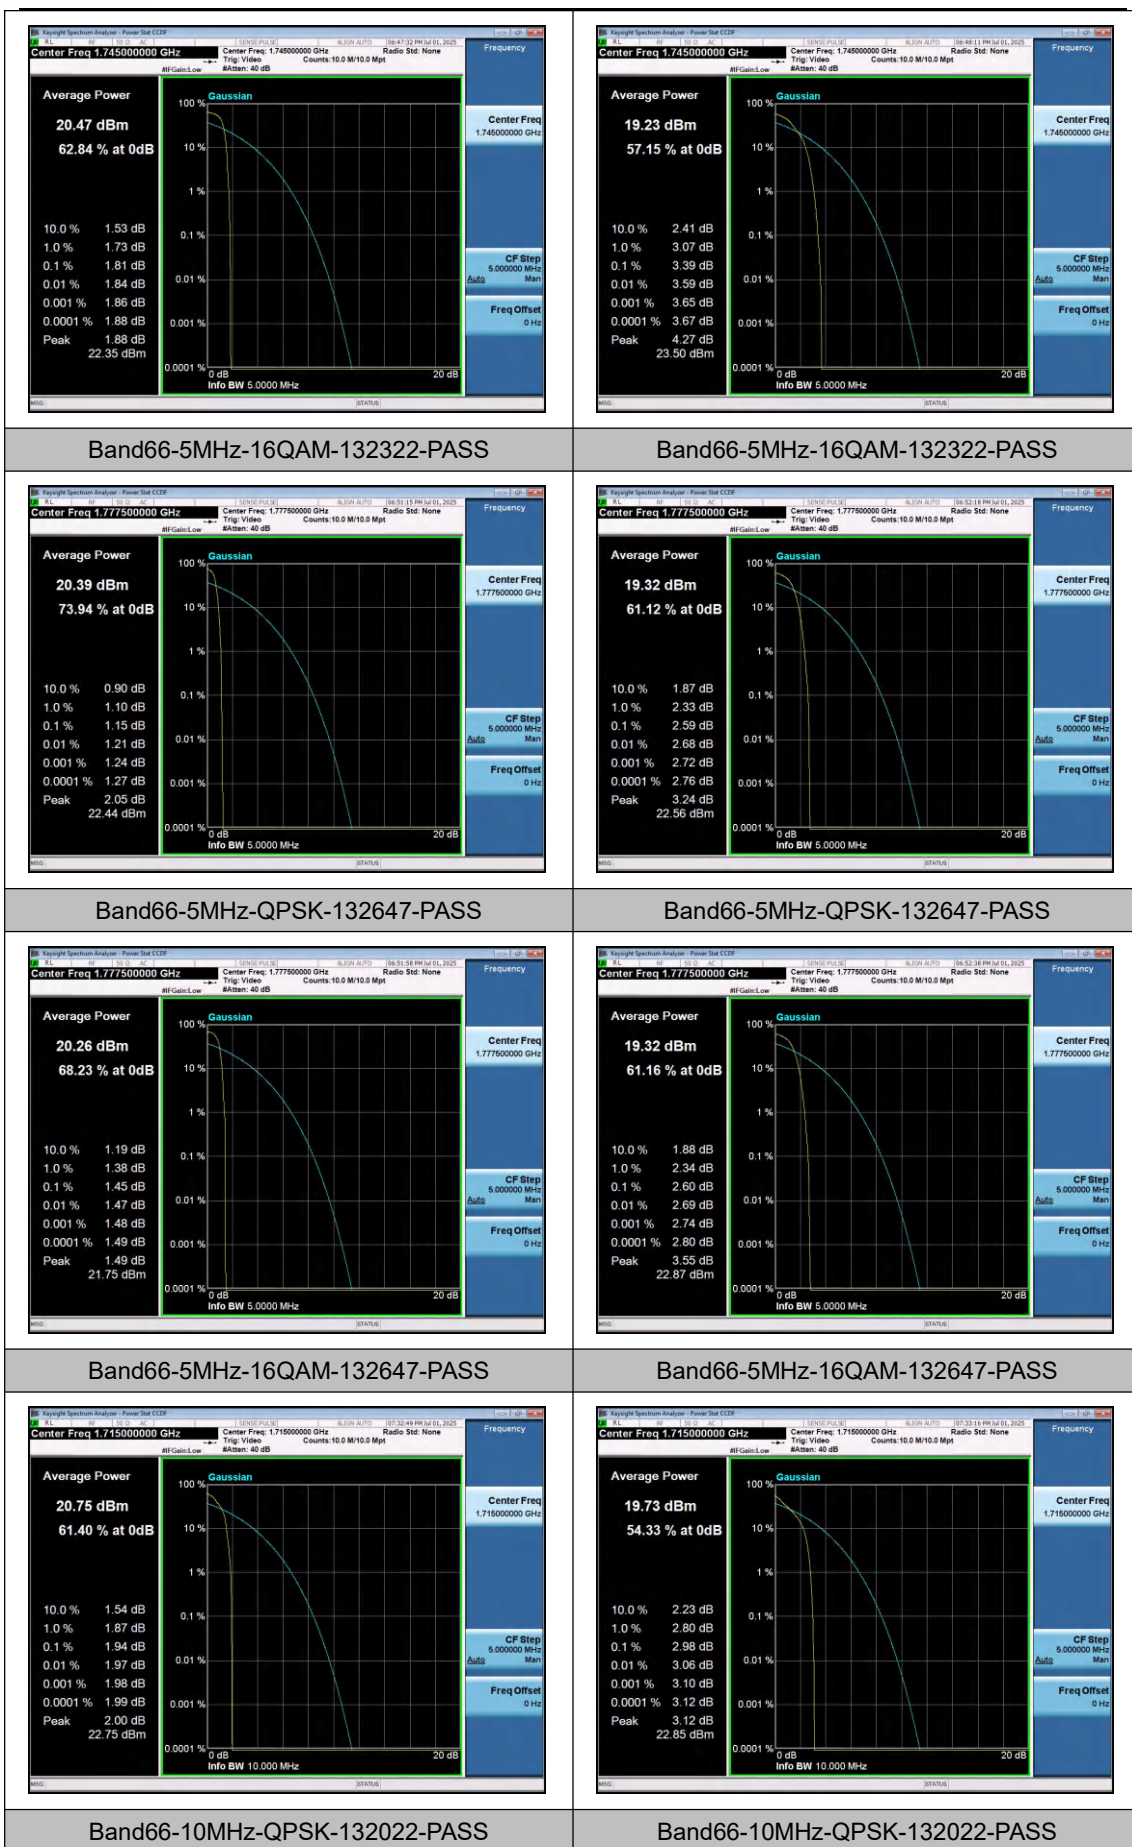


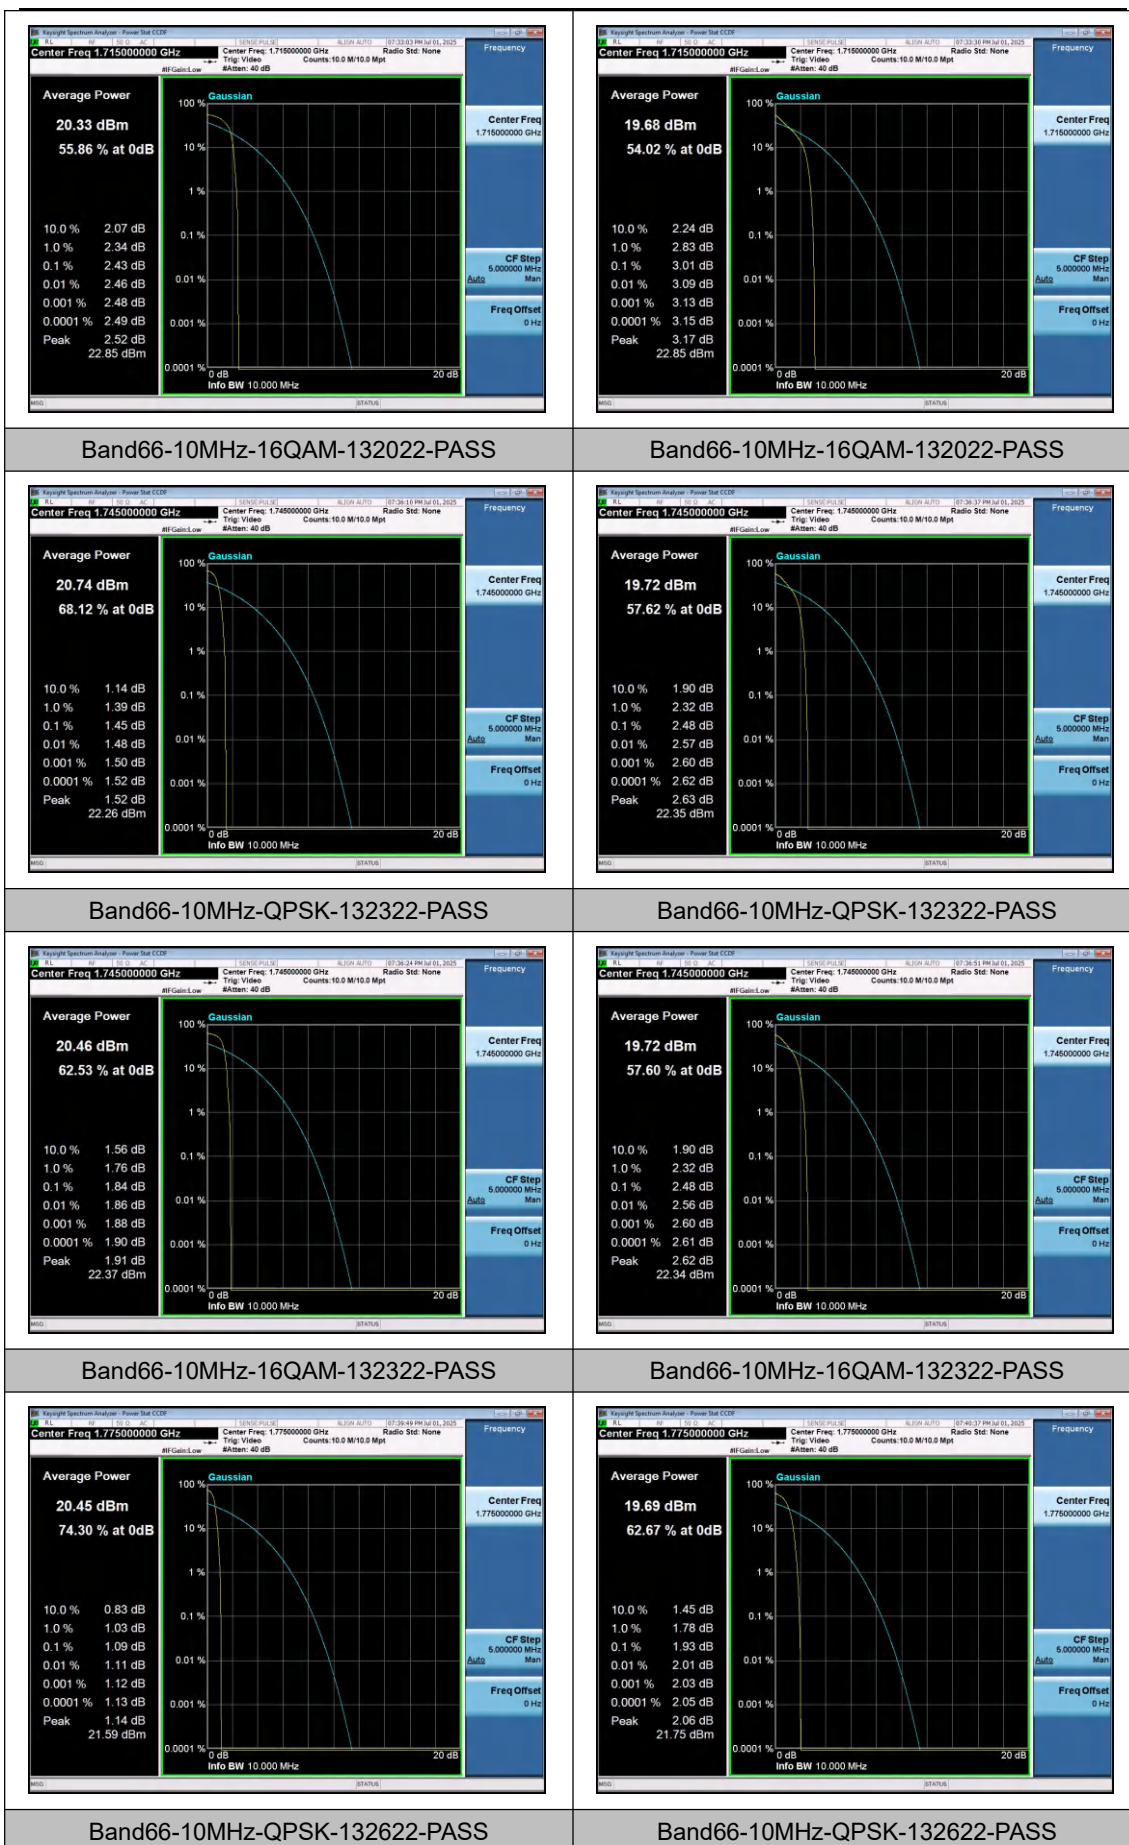

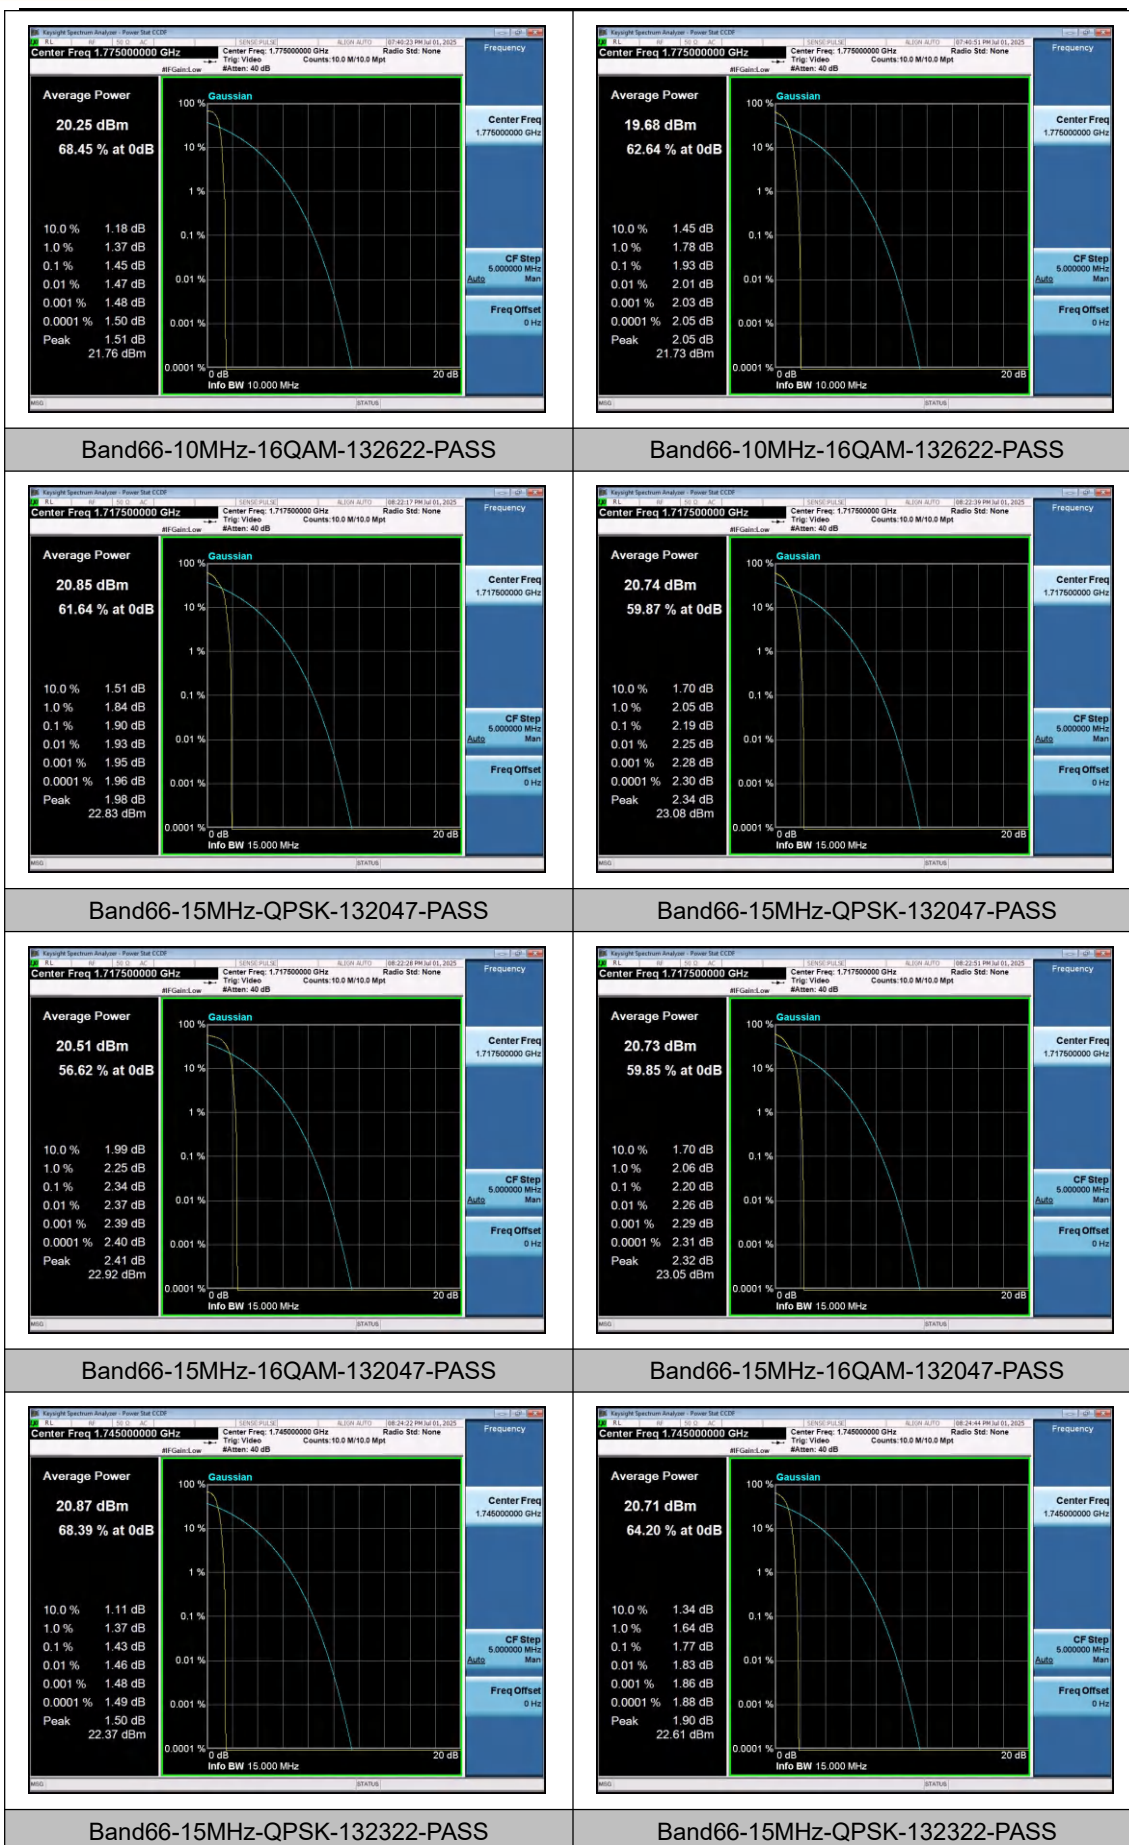



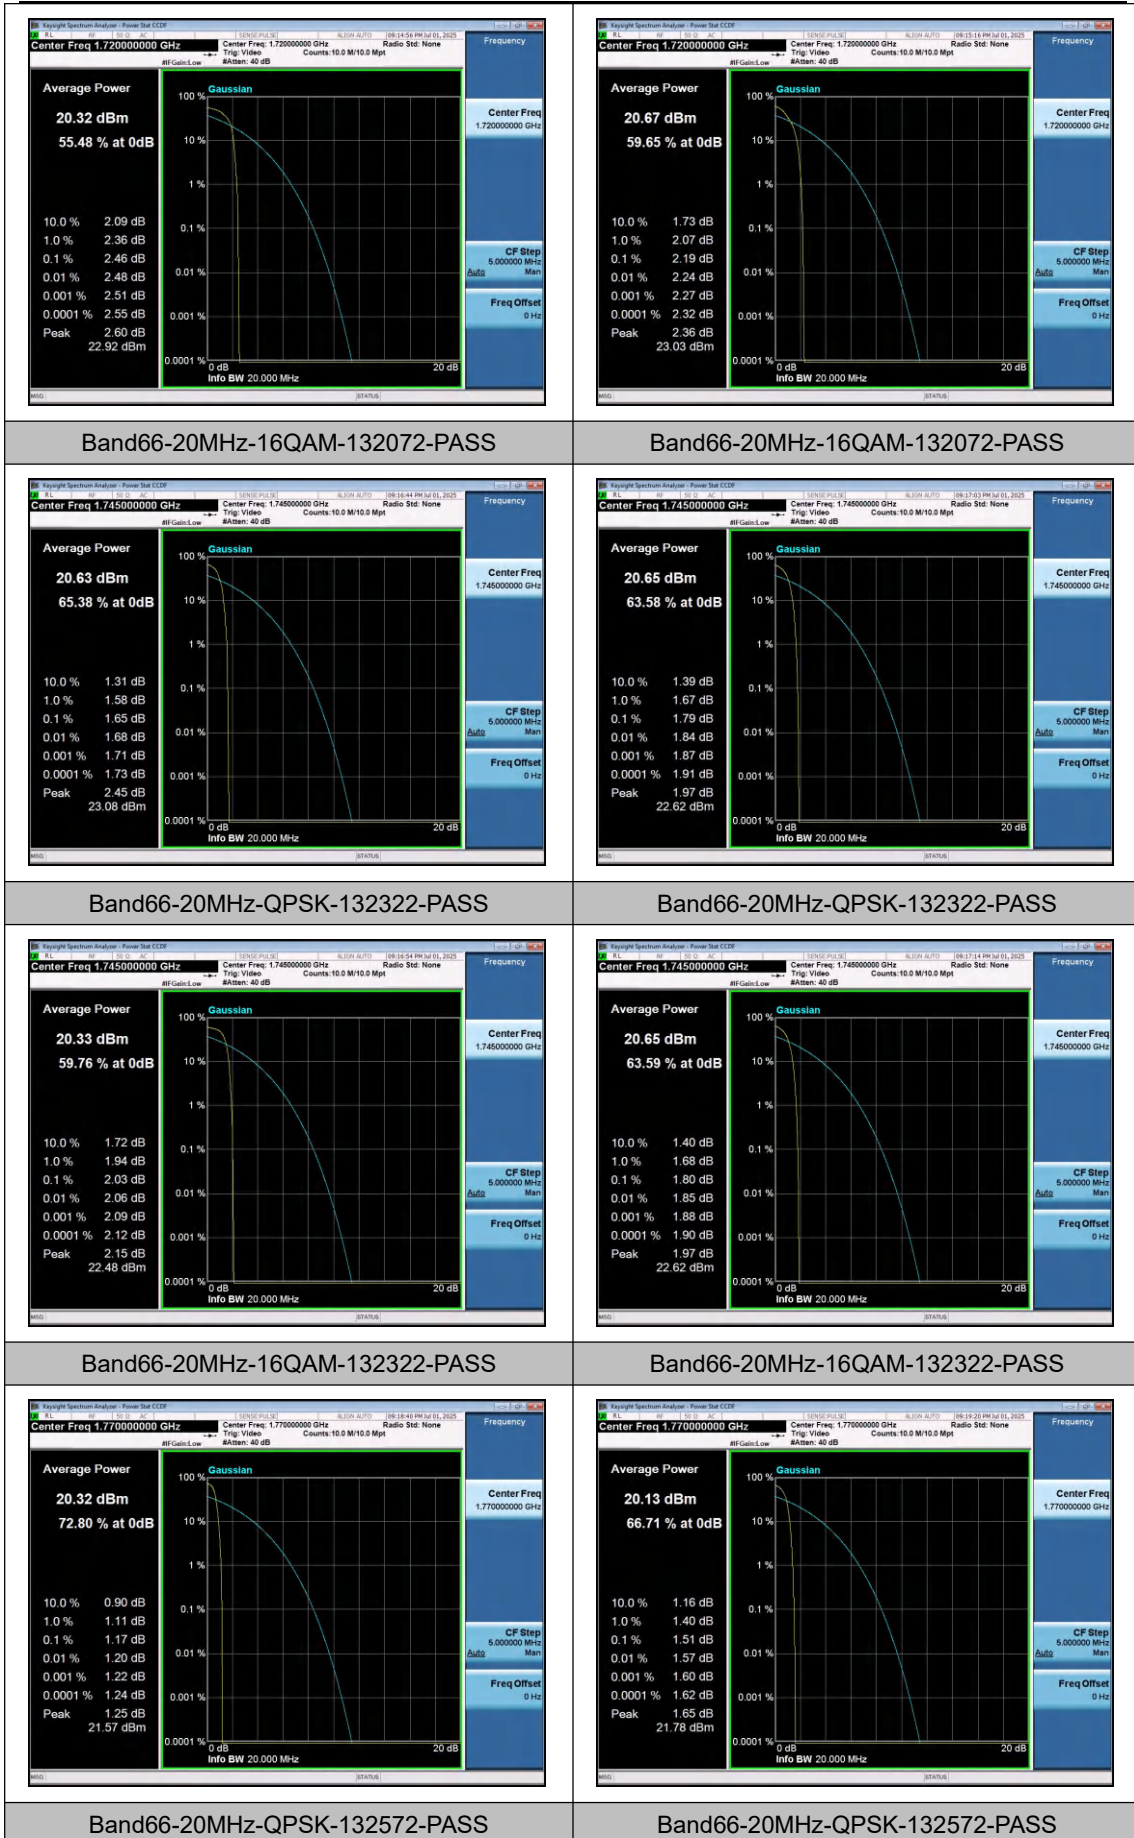

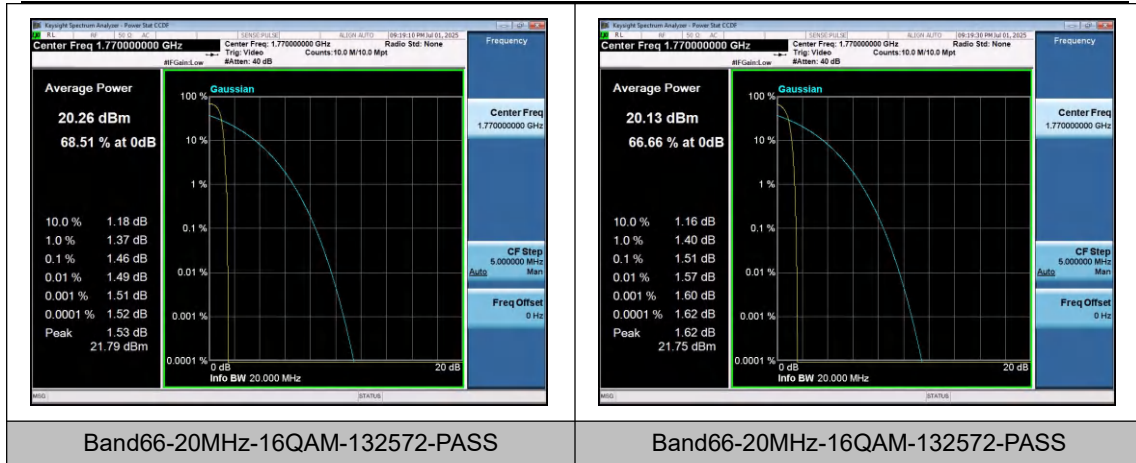

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix C: 26dB Bandwidth and Occupied Bandwidth for M1

Test Result


Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band66	1.4MHz	QPSK	131979	6	0	Low	1.0955	1.301	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	1.0929	1.301	PASS
Band66	1.4MHz	QPSK	132322	6	0	Low	1.0998	1.338	PASS
Band66	1.4MHz	16QAM	132322	6	0	Low	1.0983	1.338	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	1.1177	1.983	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	1.1206	1.980	PASS
Band66	3MHz	QPSK	131987	6	0	Low	1.1246	1.354	PASS
Band66	3MHz	16QAM	131987	6	0	Low	1.1248	1.352	PASS
Band66	3MHz	QPSK	132322	6	0	Low	1.1341	1.970	PASS
Band66	3MHz	16QAM	132322	6	0	Low	1.1344	1.976	PASS
Band66	3MHz	QPSK	132657	6	0	High	1.1621	2.094	PASS
Band66	3MHz	16QAM	132657	6	0	High	1.1624	2.121	PASS
Band66	5MHz	QPSK	131997	6	0	Low	1.2305	2.193	PASS
Band66	5MHz	16QAM	131997	6	0	Low	1.2304	2.214	PASS
Band66	5MHz	QPSK	132322	6	0	Low	1.2763	2.297	PASS
Band66	5MHz	16QAM	132322	6	0	Low	1.2830	2.303	PASS
Band66	5MHz	QPSK	132647	6	0	High	1.5588	2.783	PASS
Band66	5MHz	16QAM	132647	6	0	High	1.5530	2.753	PASS
Band66	10MHz	QPSK	132022	6	0	Low	1.4143	2.759	PASS
Band66	10MHz	16QAM	132022	6	0	Low	1.4148	2.727	PASS
Band66	10MHz	QPSK	132322	6	0	Low	1.4865	2.887	PASS
Band66	10MHz	16QAM	132322	6	0	Low	1.4940	2.872	PASS
Band66	10MHz	QPSK	132622	6	0	High	1.7956	3.018	PASS
Band66	10MHz	16QAM	132622	6	0	High	1.8162	2.992	PASS
Band66	15MHz	QPSK	132047	6	0	Low	1.9116	3.152	PASS
Band66	15MHz	16QAM	132047	6	0	Low	1.9101	3.092	PASS
Band66	15MHz	QPSK	132322	6	0	Low	2.1027	3.138	PASS
Band66	15MHz	16QAM	132322	6	0	Low	2.0917	3.231	PASS
Band66	15MHz	QPSK	132597	6	0	High	2.3002	3.355	PASS
Band66	15MHz	16QAM	132597	6	0	High	2.2642	3.305	PASS
Band66	20MHz	QPSK	132072	6	0	Low	2.5356	5.222	PASS
Band66	20MHz	16QAM	132072	6	0	Low	2.7462	5.037	PASS
Band66	20MHz	QPSK	132322	6	0	Low	2.7901	5.062	PASS
Band66	20MHz	16QAM	132322	6	0	Low	2.7563	4.914	PASS
Band66	20MHz	QPSK	132572	6	0	High	2.8880	5.454	PASS
Band66	20MHz	16QAM	132572	6	0	High	2.9617	5.356	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

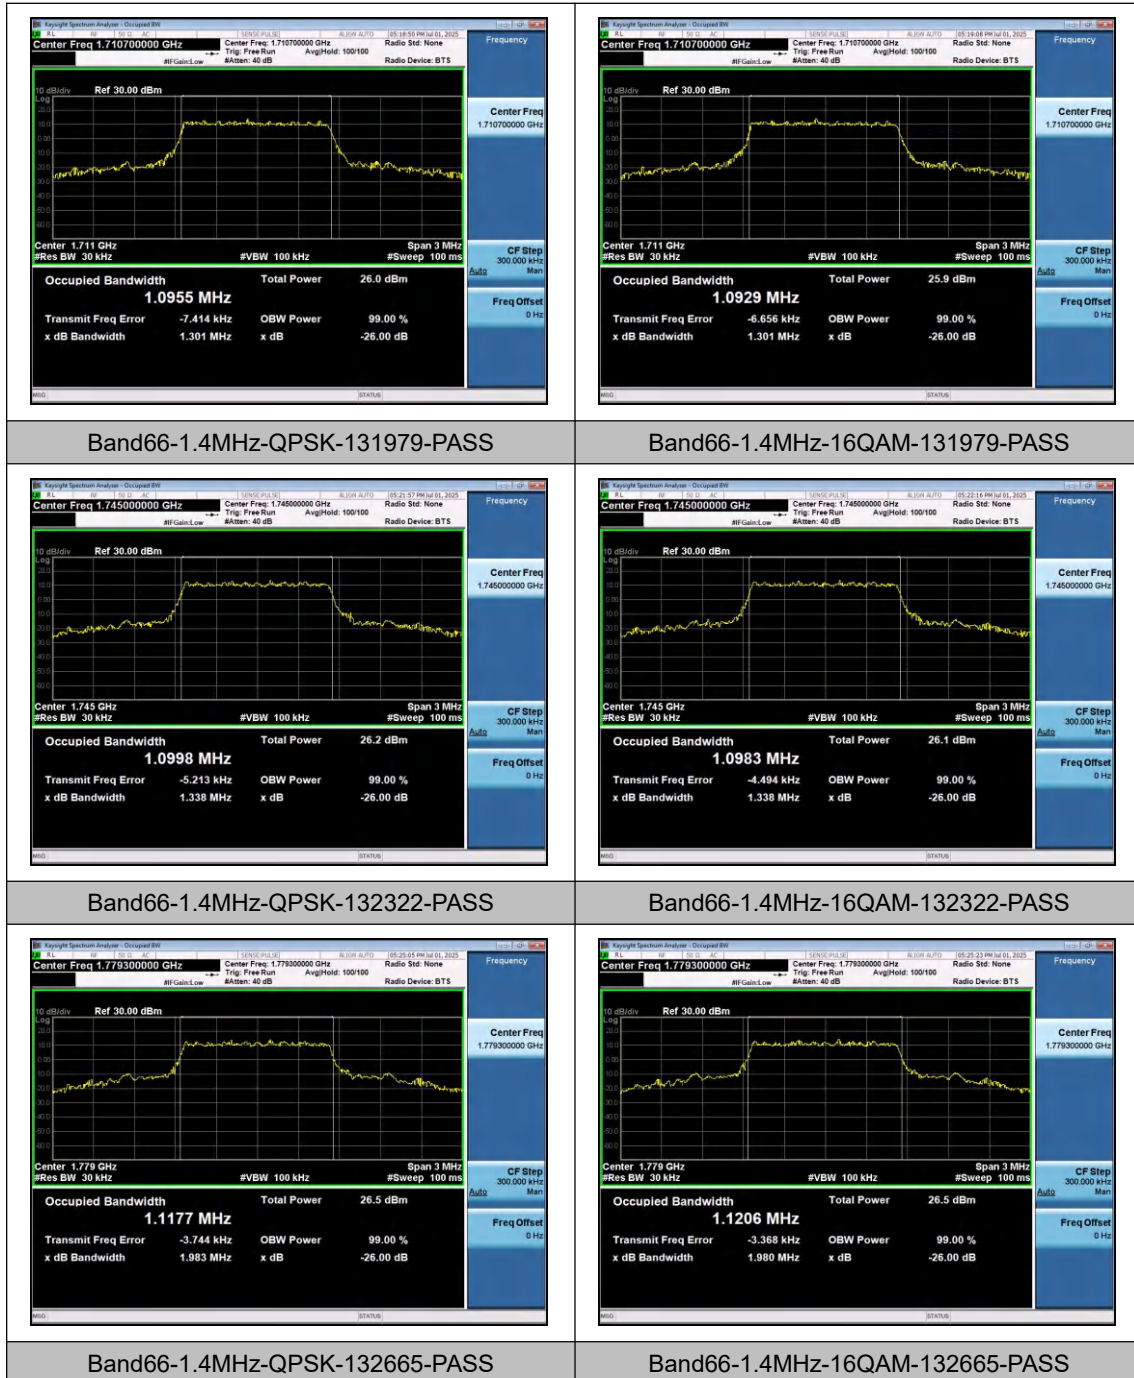

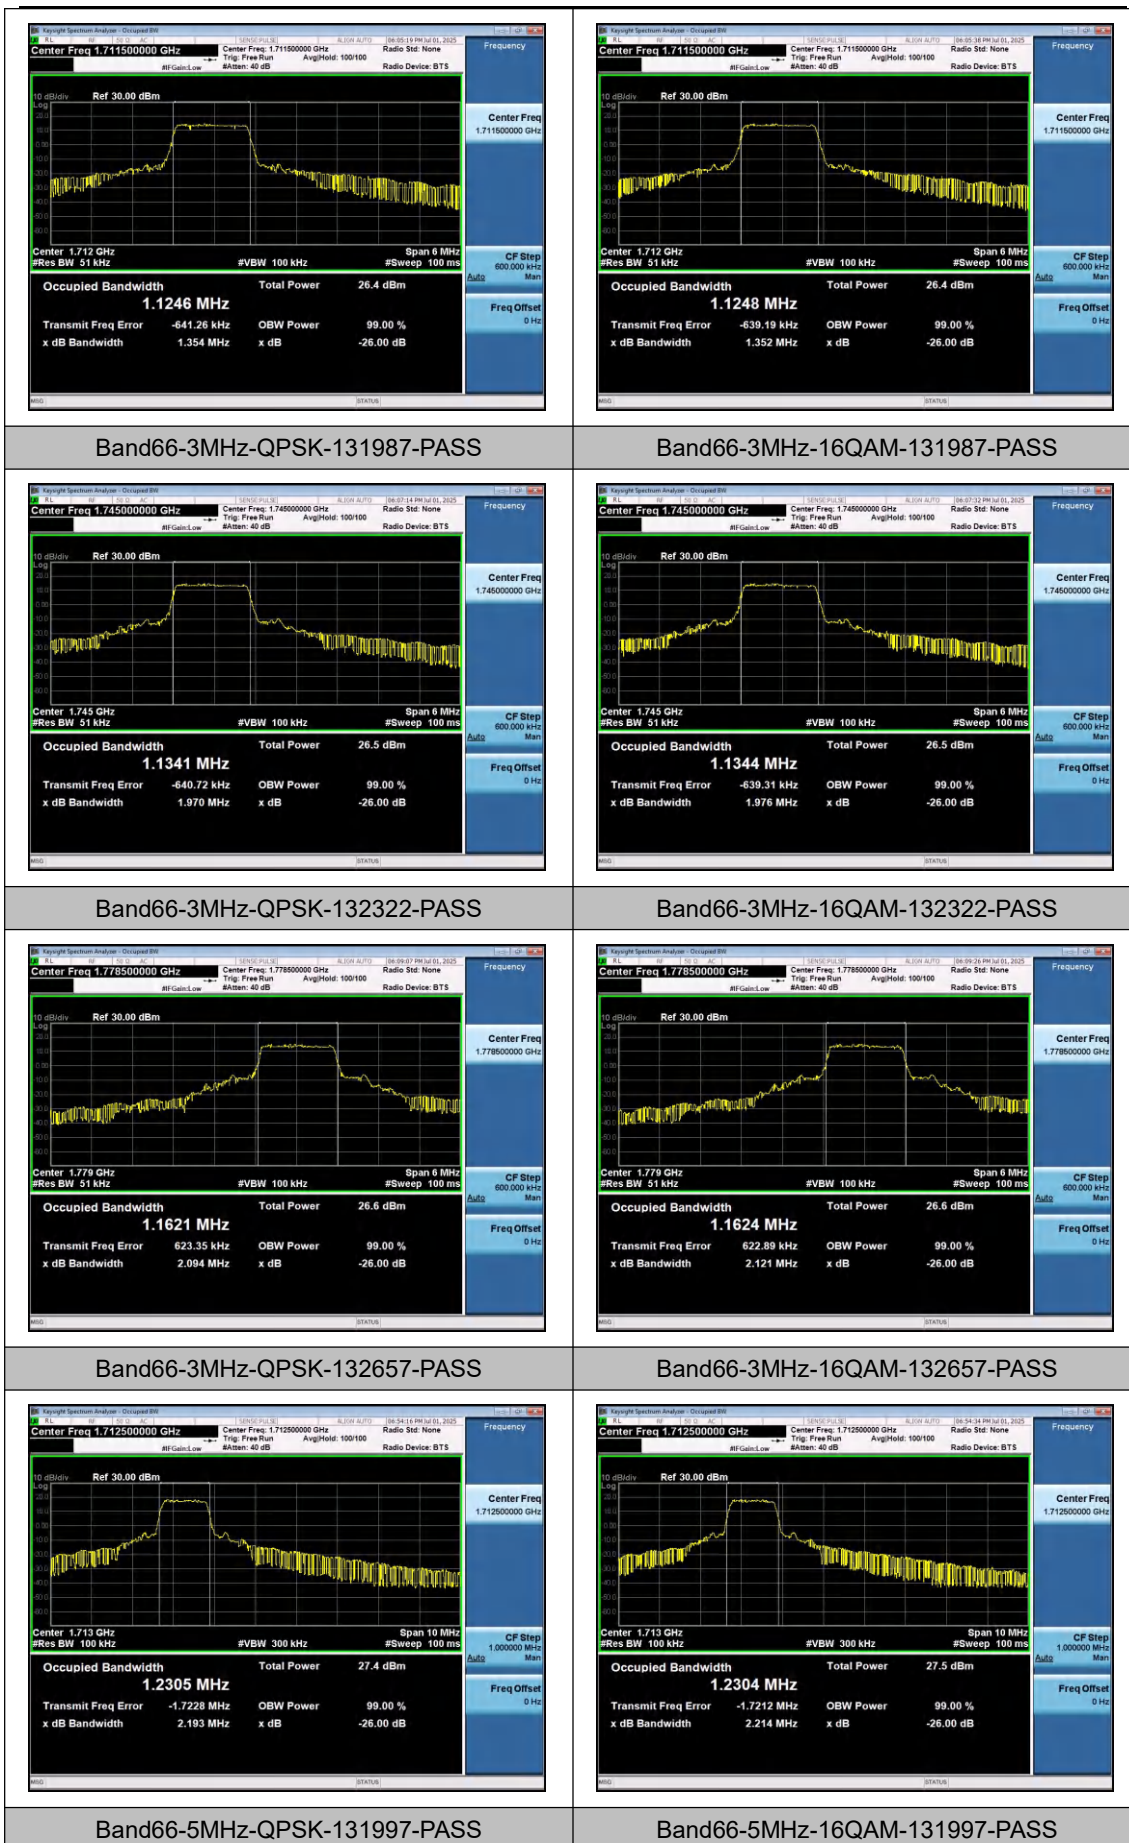

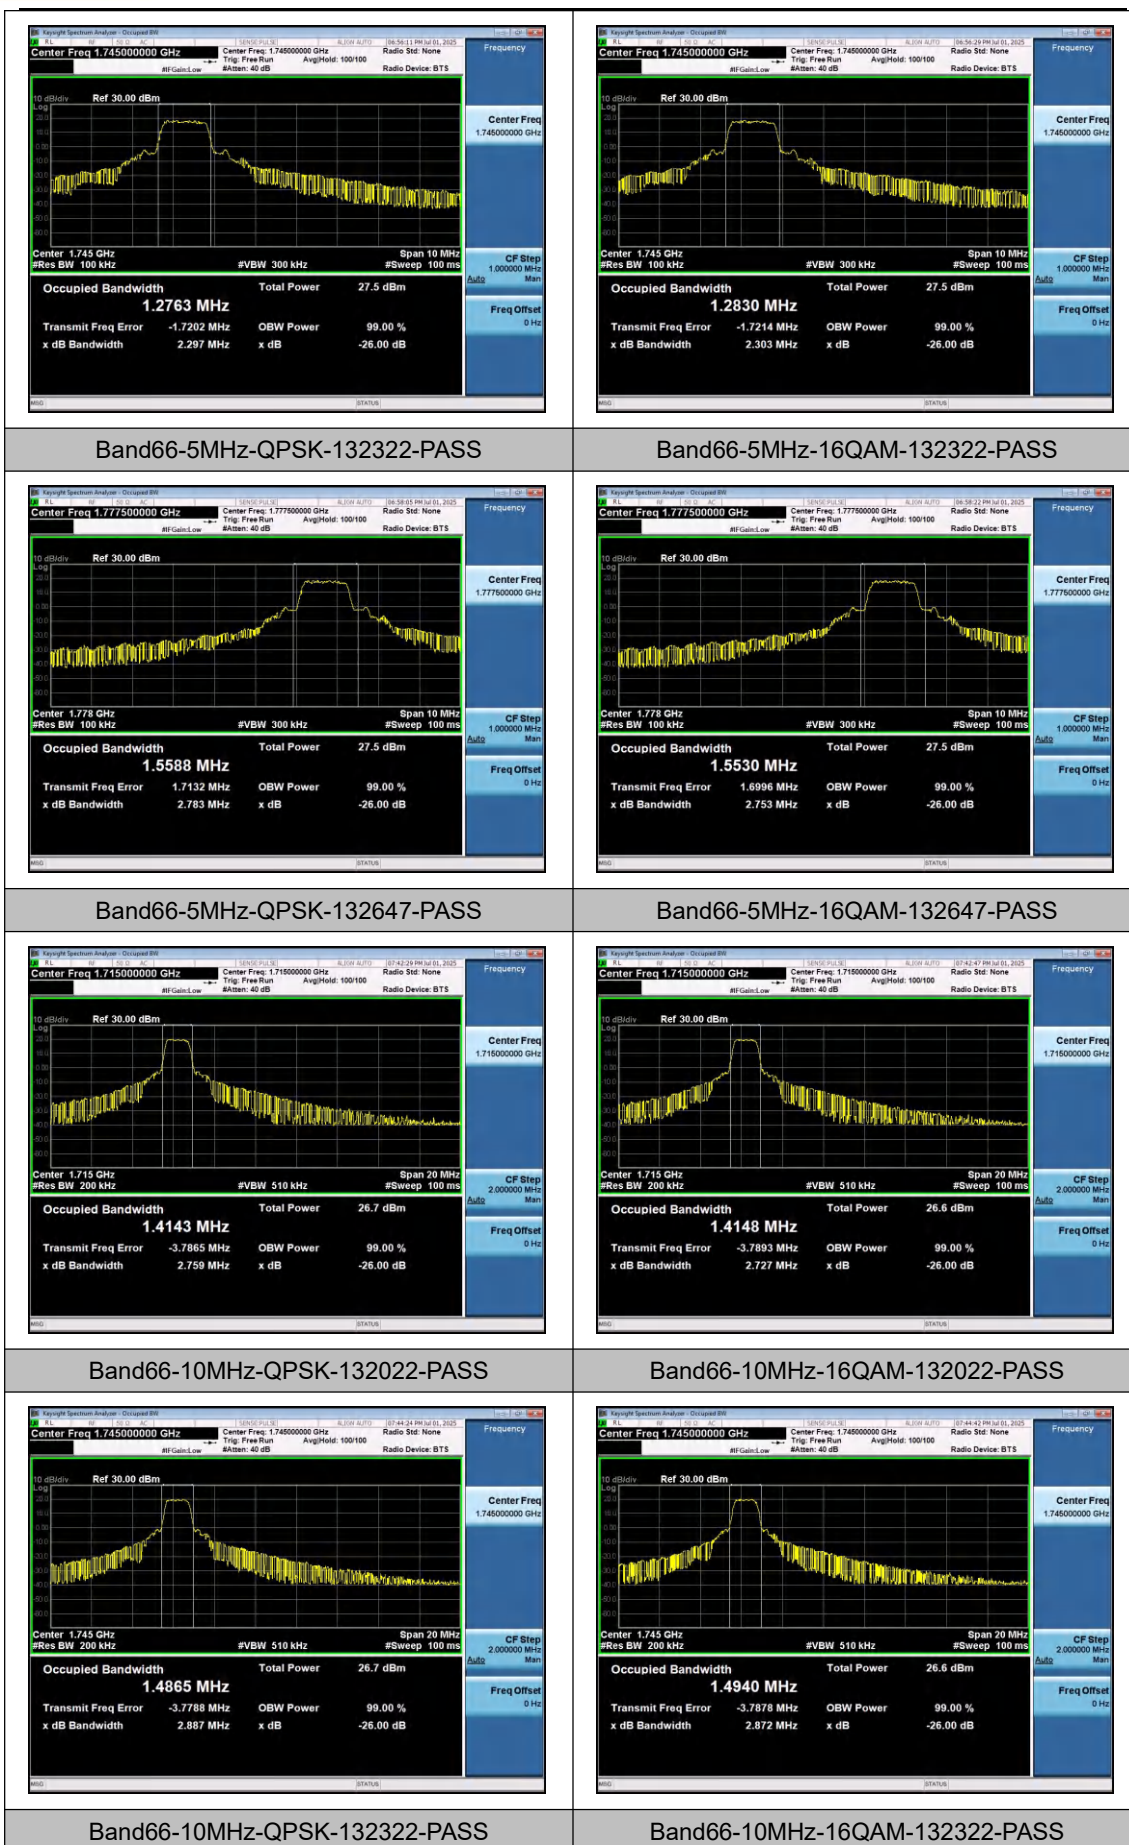

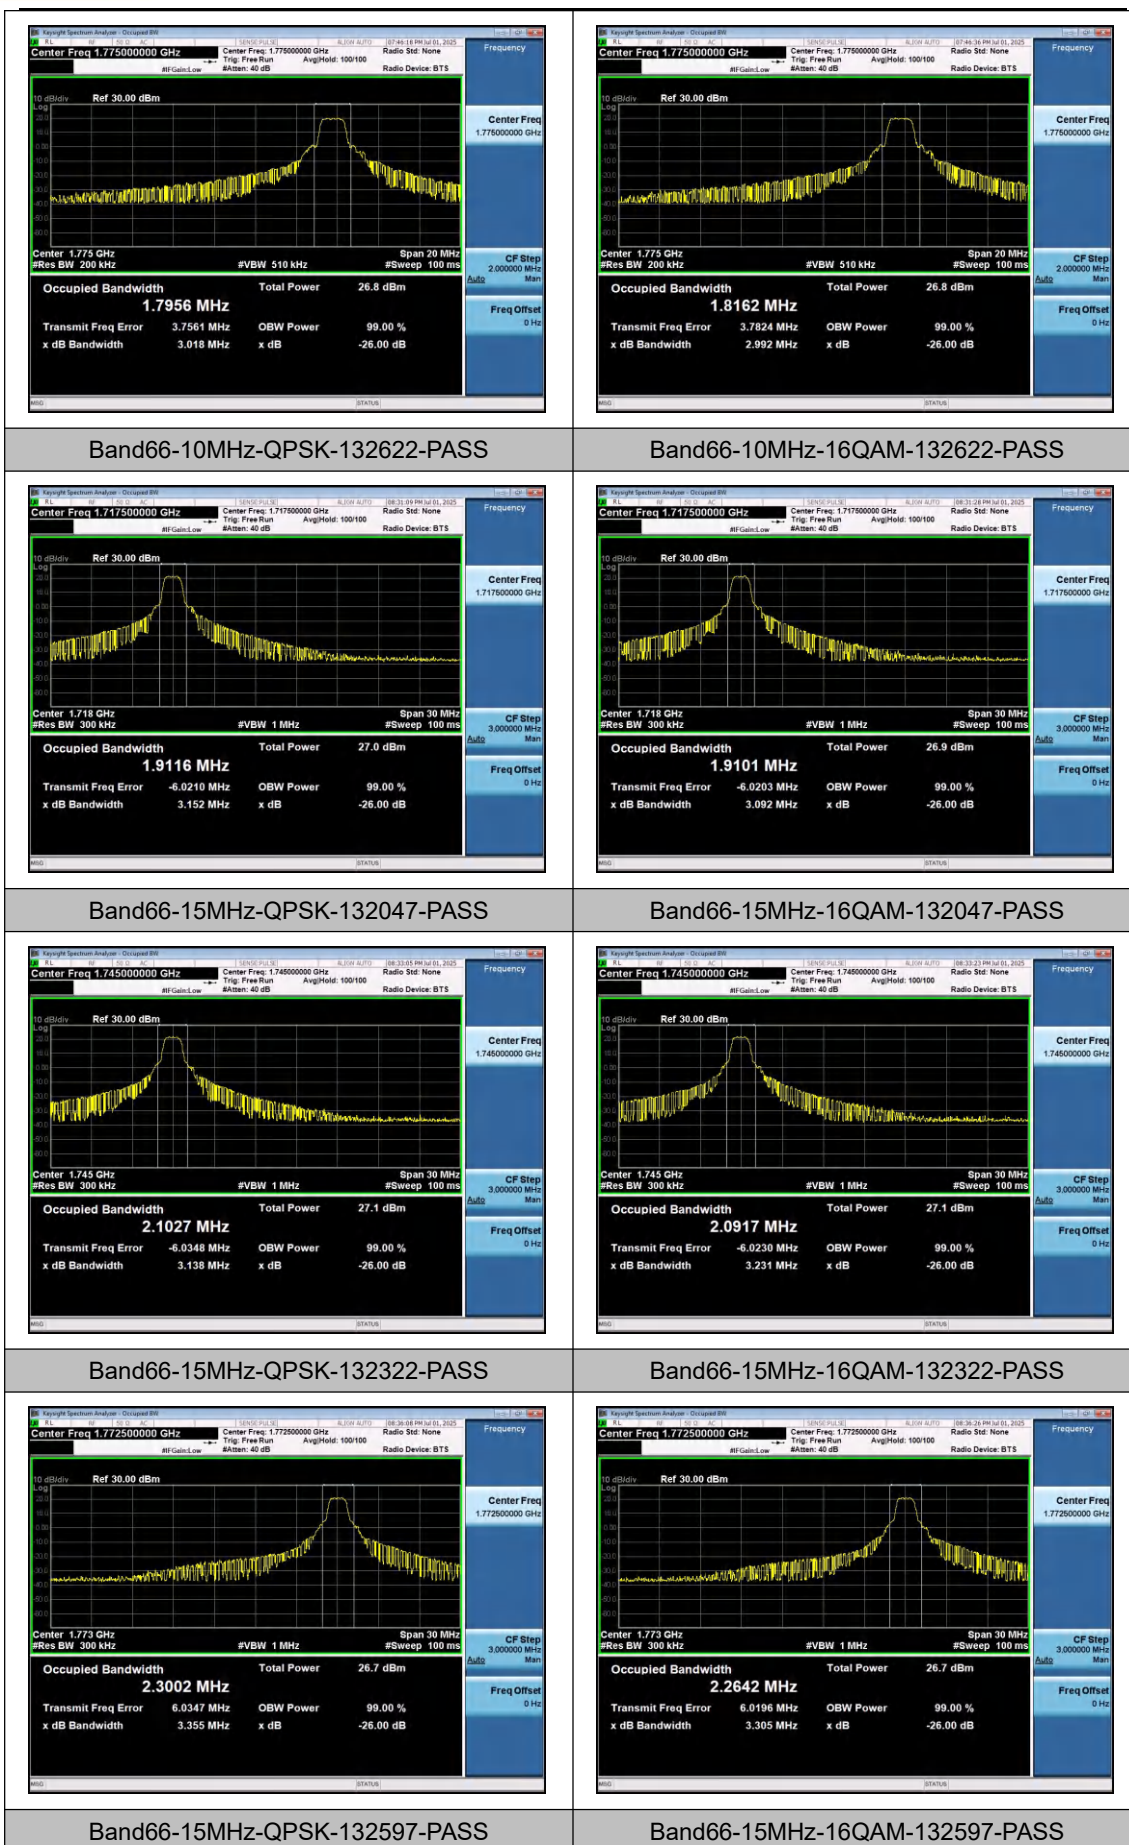

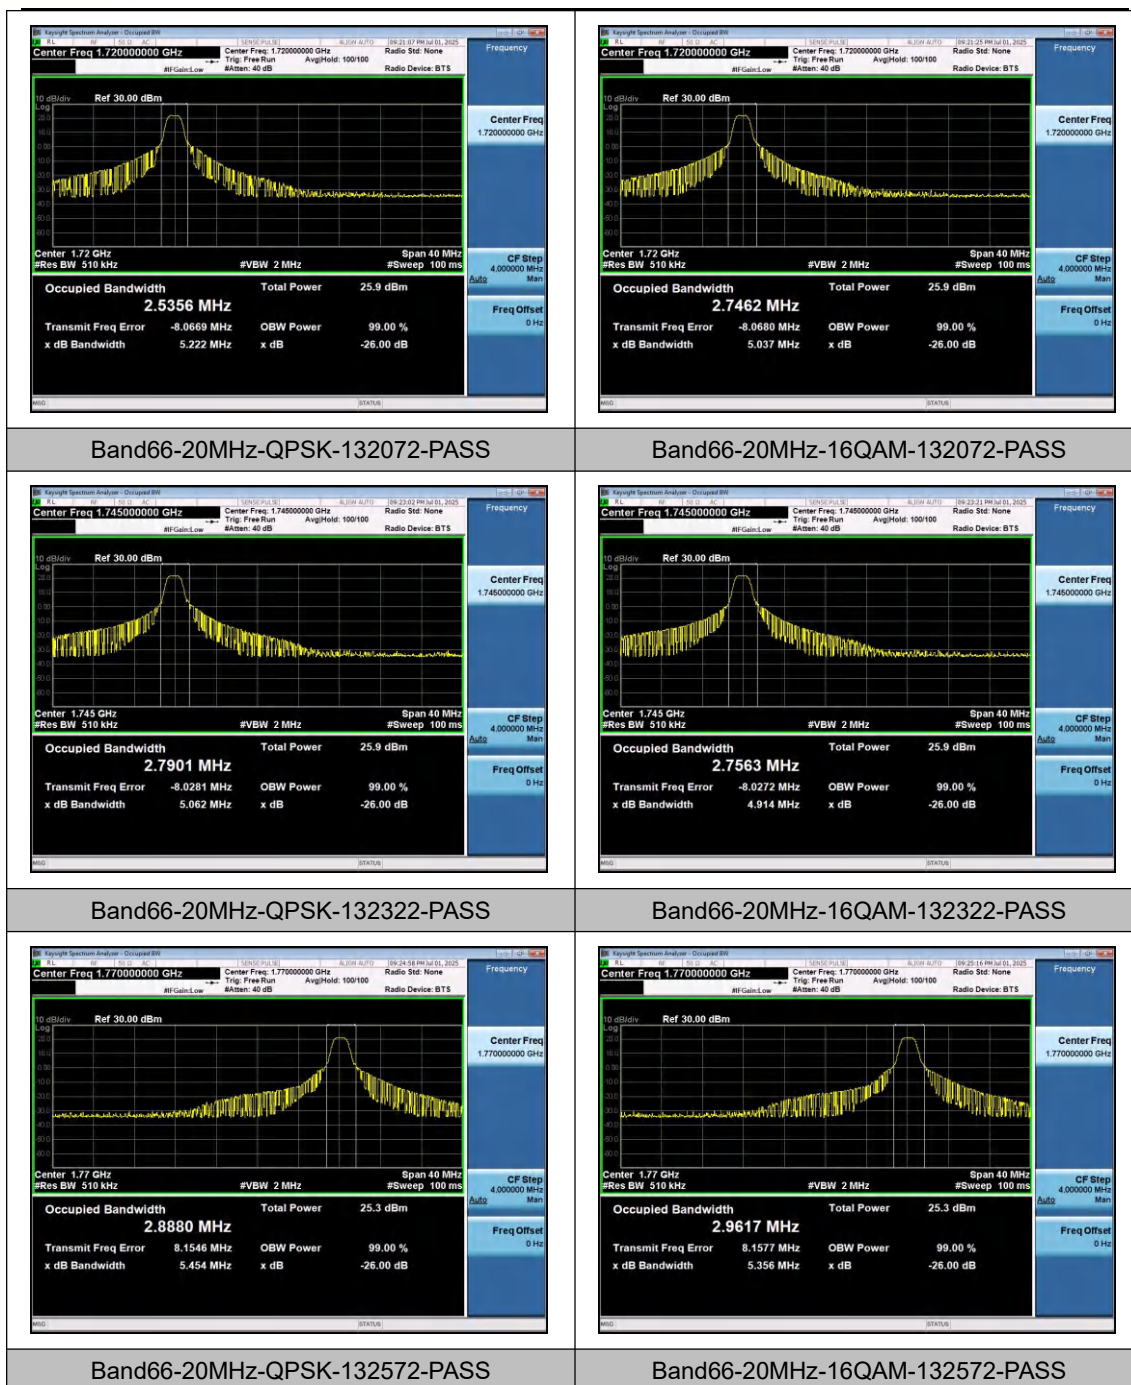

Appendix D: Band Edge for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Result(dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1	0	Low	-30.10	PASS
Band66	1.4MHz	QPSK	131979	6	0	Low	-42.09	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	-35.25	PASS
Band66	1.4MHz	16QAM	131979	6	0	Low	-43.24	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	-58.47	PASS
Band66	1.4MHz	QPSK	132665	6	0	High	-52.17	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	-41.32	PASS
Band66	1.4MHz	16QAM	132665	6	0	High	-40.48	PASS
Band66	3MHz	QPSK	131987	1	0	Low	-54.13	PASS
Band66	3MHz	QPSK	131987	6	0	Low	-43.93	PASS
Band66	3MHz	16QAM	131987	1	0	Low	-58.20	PASS
Band66	3MHz	16QAM	131987	6	0	Low	-51.33	PASS
Band66	3MHz	QPSK	132657	1	5	High	-58.40	PASS
Band66	3MHz	QPSK	132657	6	0	High	-48.58	PASS
Band66	3MHz	16QAM	132657	1	5	High	-57.51	PASS
Band66	3MHz	16QAM	132657	6	0	High	-38.23	PASS
Band66	5MHz	QPSK	131997	1	0	Low	-41.60	PASS
Band66	5MHz	QPSK	131997	6	0	Low	-34.22	PASS
Band66	5MHz	16QAM	131997	1	0	Low	-51.84	PASS
Band66	5MHz	16QAM	131997	6	0	Low	-40.48	PASS
Band66	5MHz	QPSK	132647	1	5	High	-49.70	PASS
Band66	5MHz	QPSK	132647	6	0	High	-30.53	PASS
Band66	5MHz	16QAM	132647	1	5	High	-40.16	PASS
Band66	5MHz	16QAM	132647	6	0	High	-29.72	PASS
Band66	10MHz	QPSK	132022	1	0	Low	-53.73	PASS
Band66	10MHz	QPSK	132022	6	0	Low	-41.16	PASS
Band66	10MHz	16QAM	132022	1	0	Low	-52.10	PASS
Band66	10MHz	16QAM	132022	6	0	Low	-45.26	PASS
Band66	10MHz	QPSK	132622	1	5	High	-56.74	PASS
Band66	10MHz	QPSK	132622	6	0	High	-33.25	PASS
Band66	10MHz	16QAM	132622	1	5	High	-51.71	PASS
Band66	10MHz	16QAM	132622	6	0	High	-31.89	PASS
Band66	15MHz	QPSK	132047	1	0	Low	-54.65	PASS
Band66	15MHz	QPSK	132047	6	0	Low	-40.60	PASS
Band66	15MHz	16QAM	132047	1	0	Low	-53.87	PASS
Band66	15MHz	16QAM	132047	6	0	Low	-38.97	PASS
Band66	15MHz	QPSK	132597	1	5	High	-52.82	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Band66	15MHz	QPSK	132597	6	0	High	-35.62	PASS
Band66	15MHz	16QAM	132597	1	5	High	-53.79	PASS
Band66	15MHz	16QAM	132597	6	0	High	-40.54	PASS
Band66	20MHz	QPSK	132072	1	0	Low	-53.88	PASS
Band66	20MHz	QPSK	132072	6	0	Low	-40.64	PASS
Band66	20MHz	16QAM	132072	1	0	Low	-53.95	PASS
Band66	20MHz	16QAM	132072	6	0	Low	-41.69	PASS
Band66	20MHz	QPSK	132572	1	5	High	-54.02	PASS
Band66	20MHz	QPSK	132572	6	0	High	-43.39	PASS
Band66	20MHz	16QAM	132572	1	5	High	-52.40	PASS
Band66	20MHz	16QAM	132572	6	0	High	-43.52	PASS


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Test Graphs

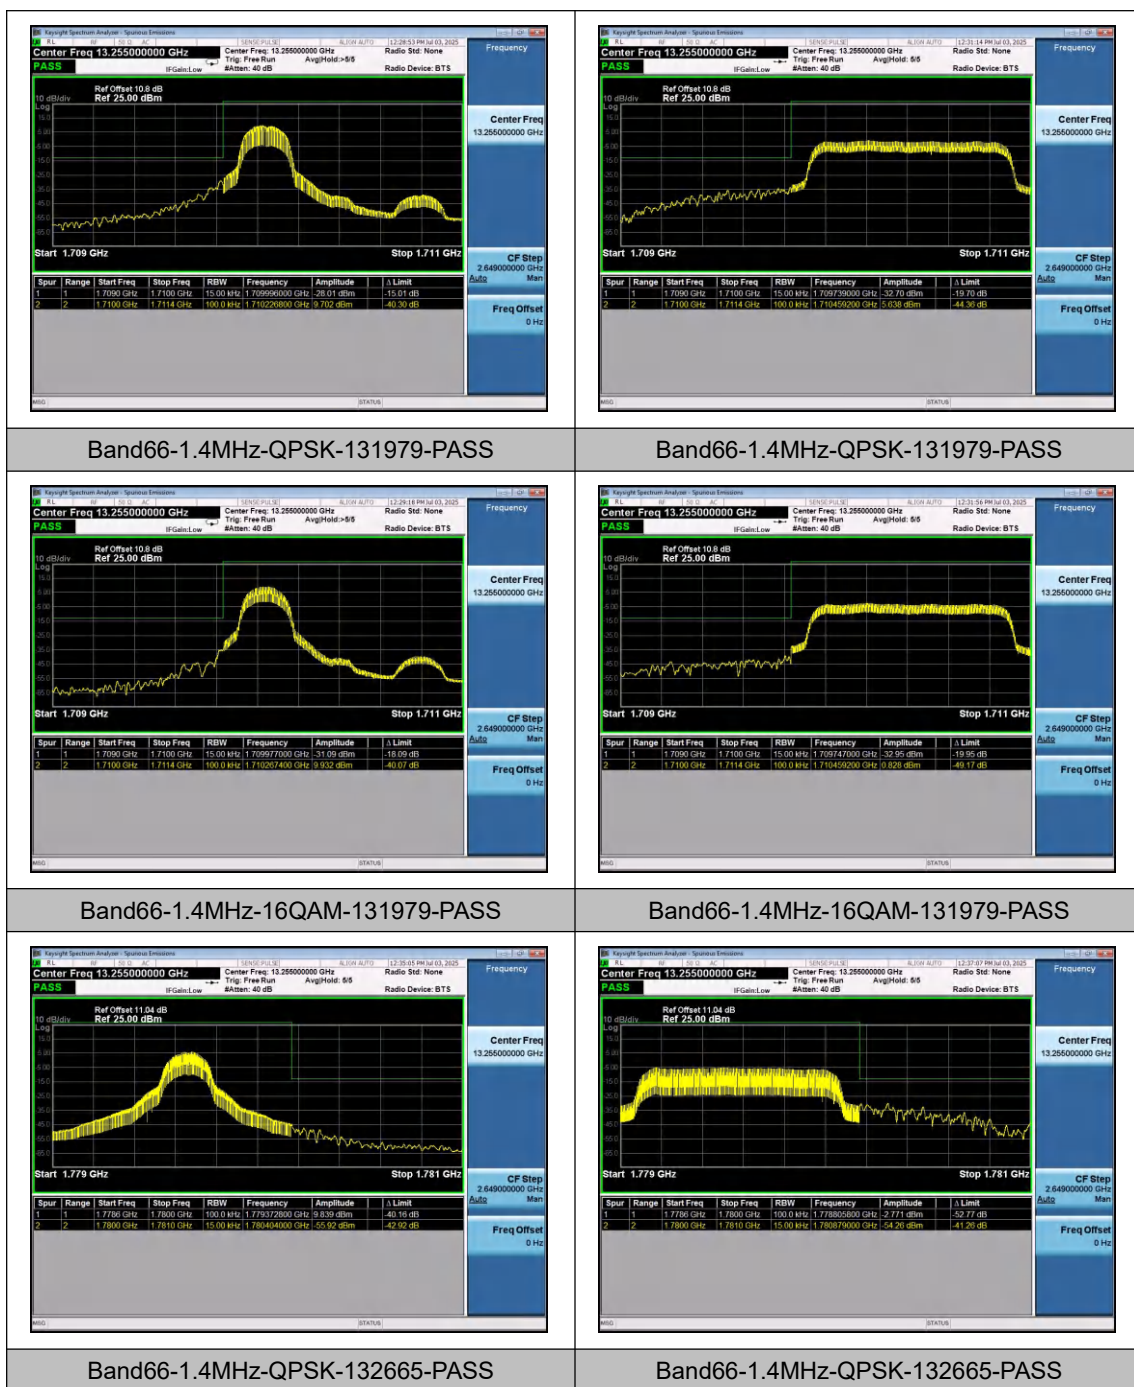


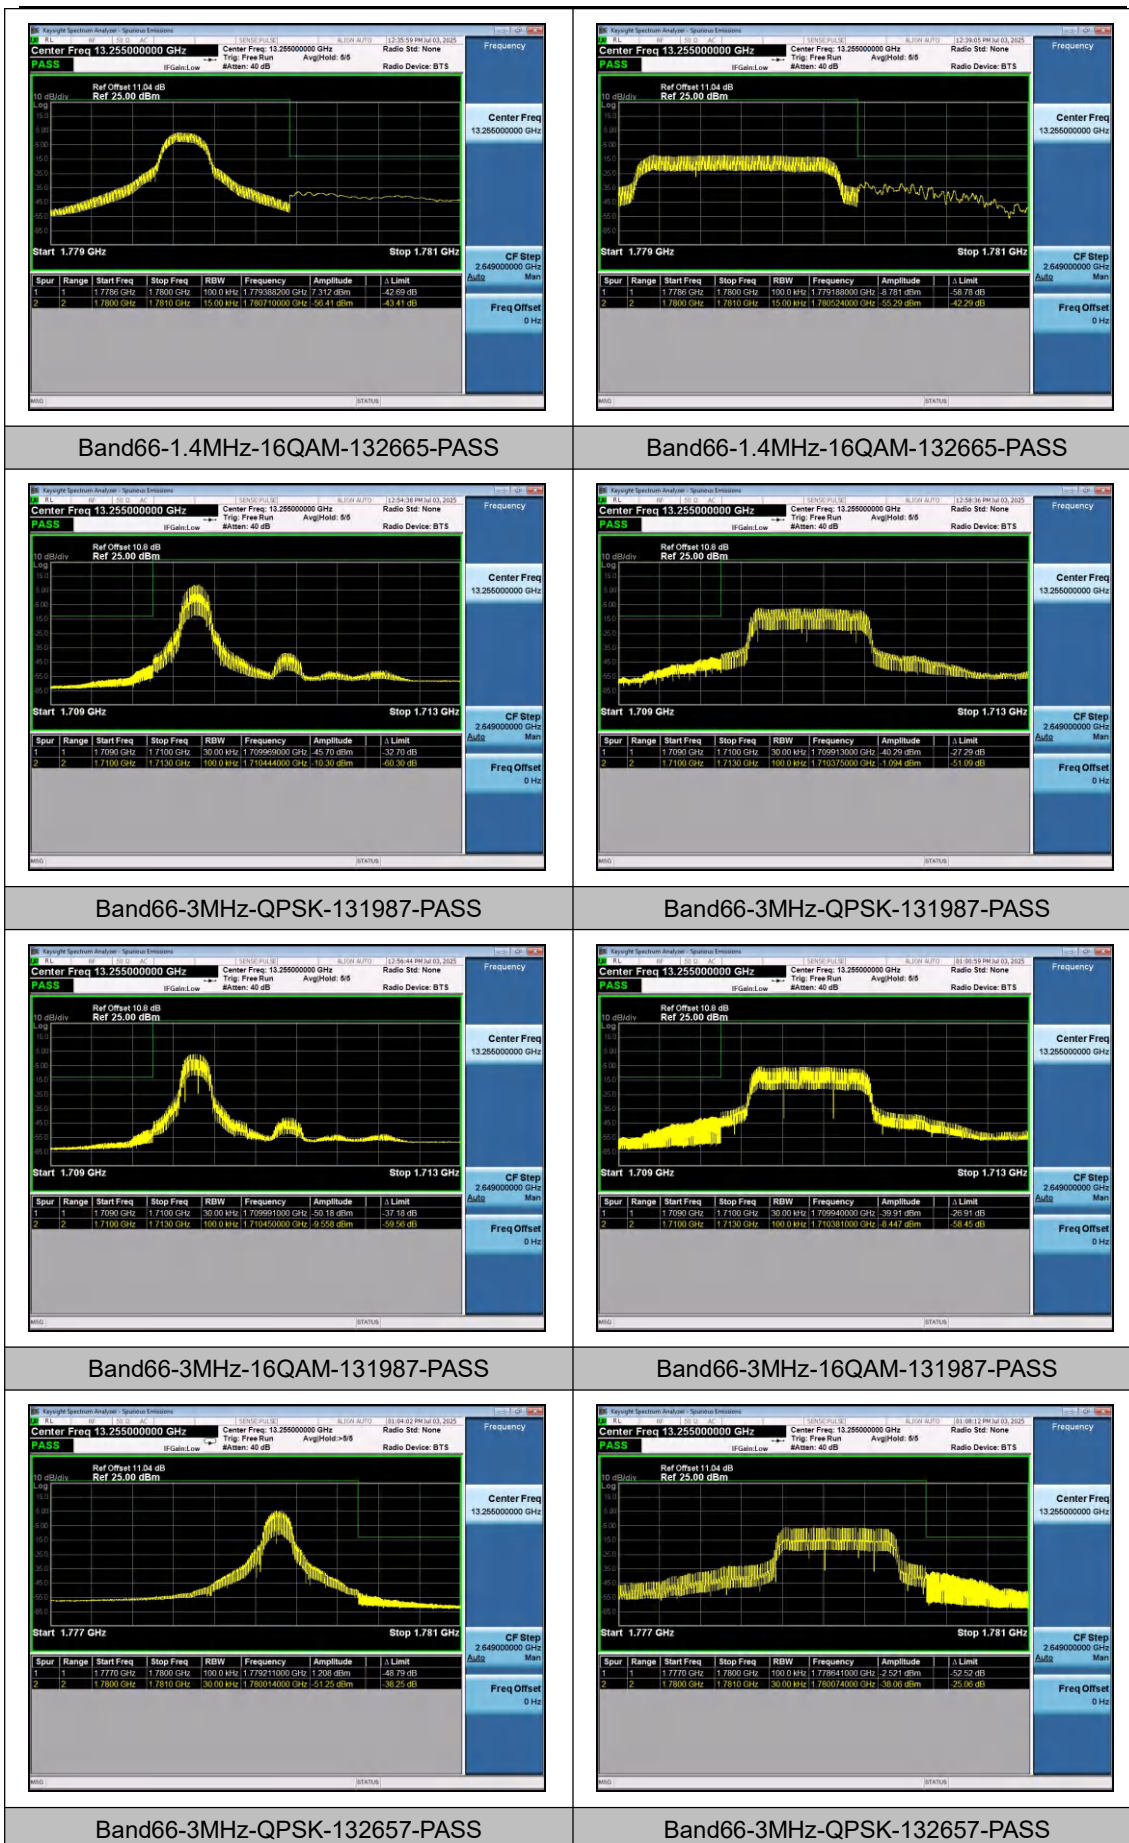


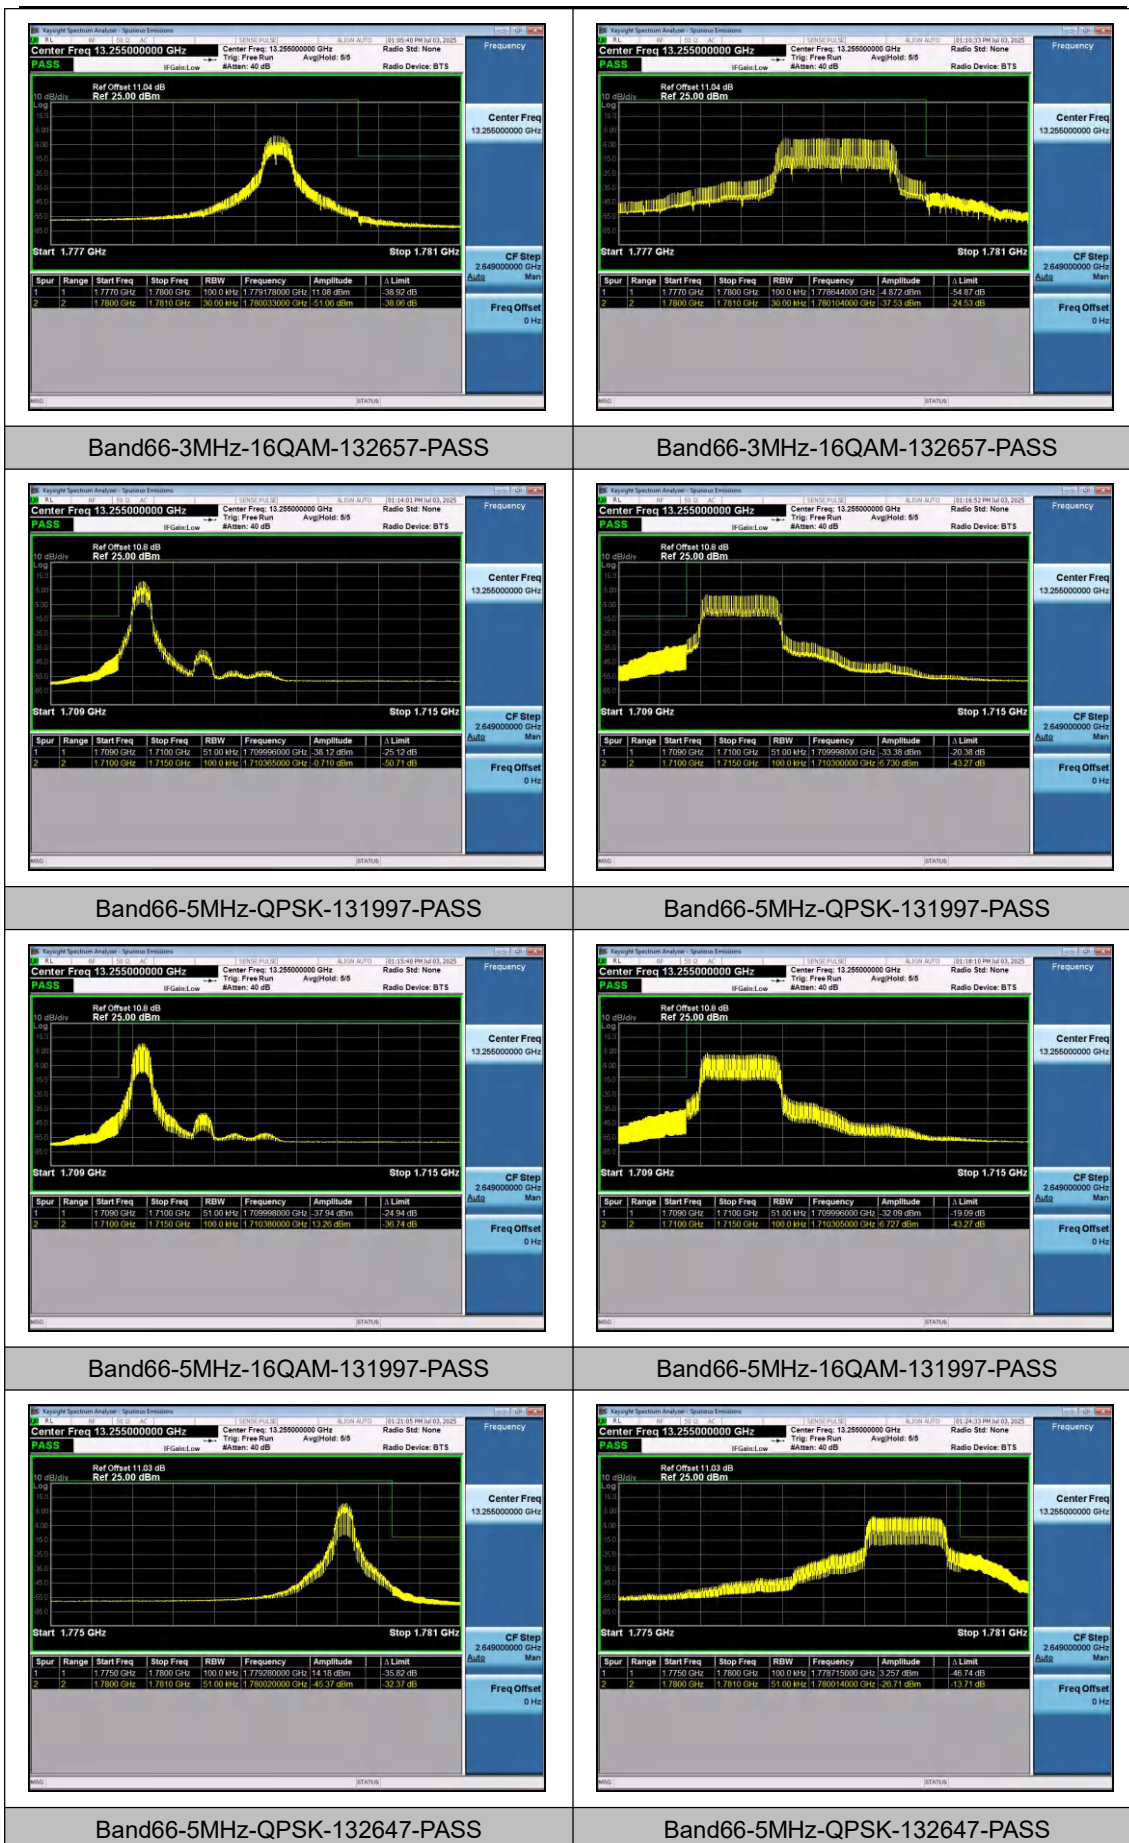

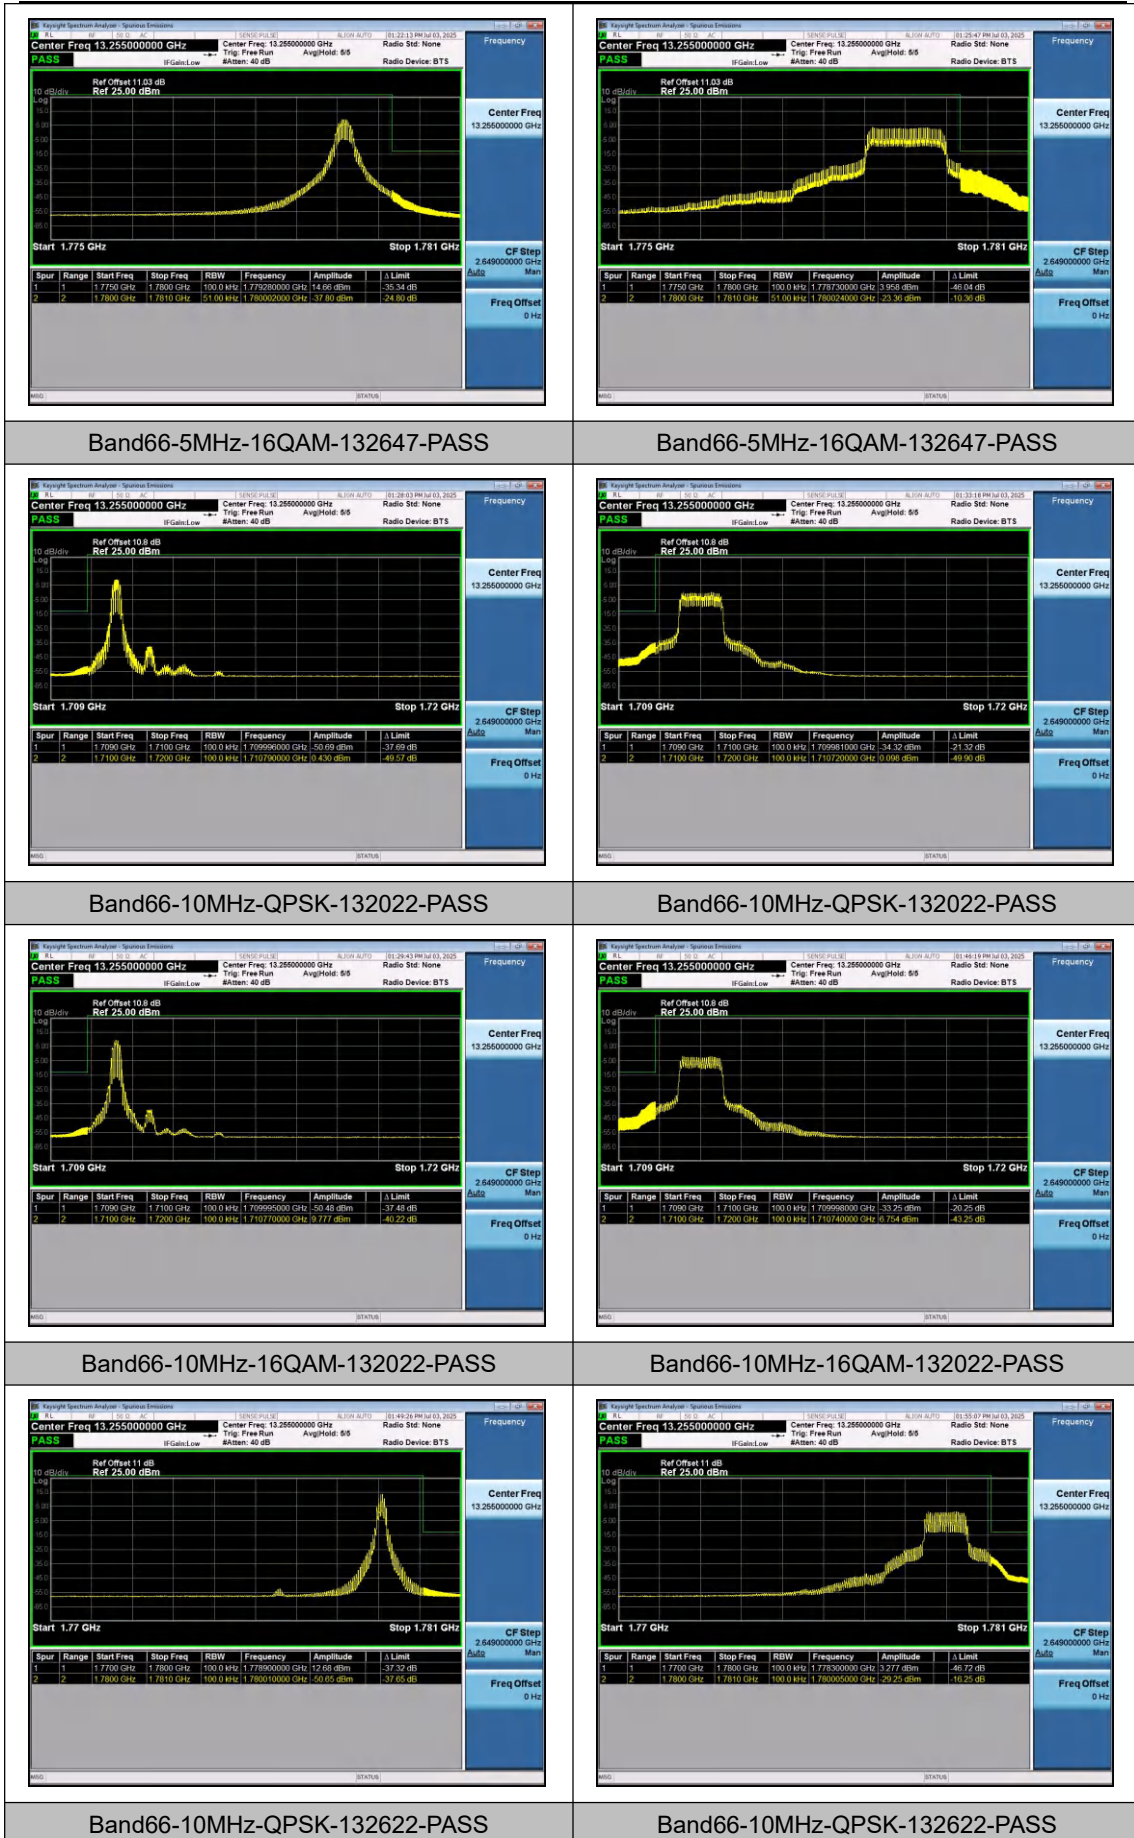

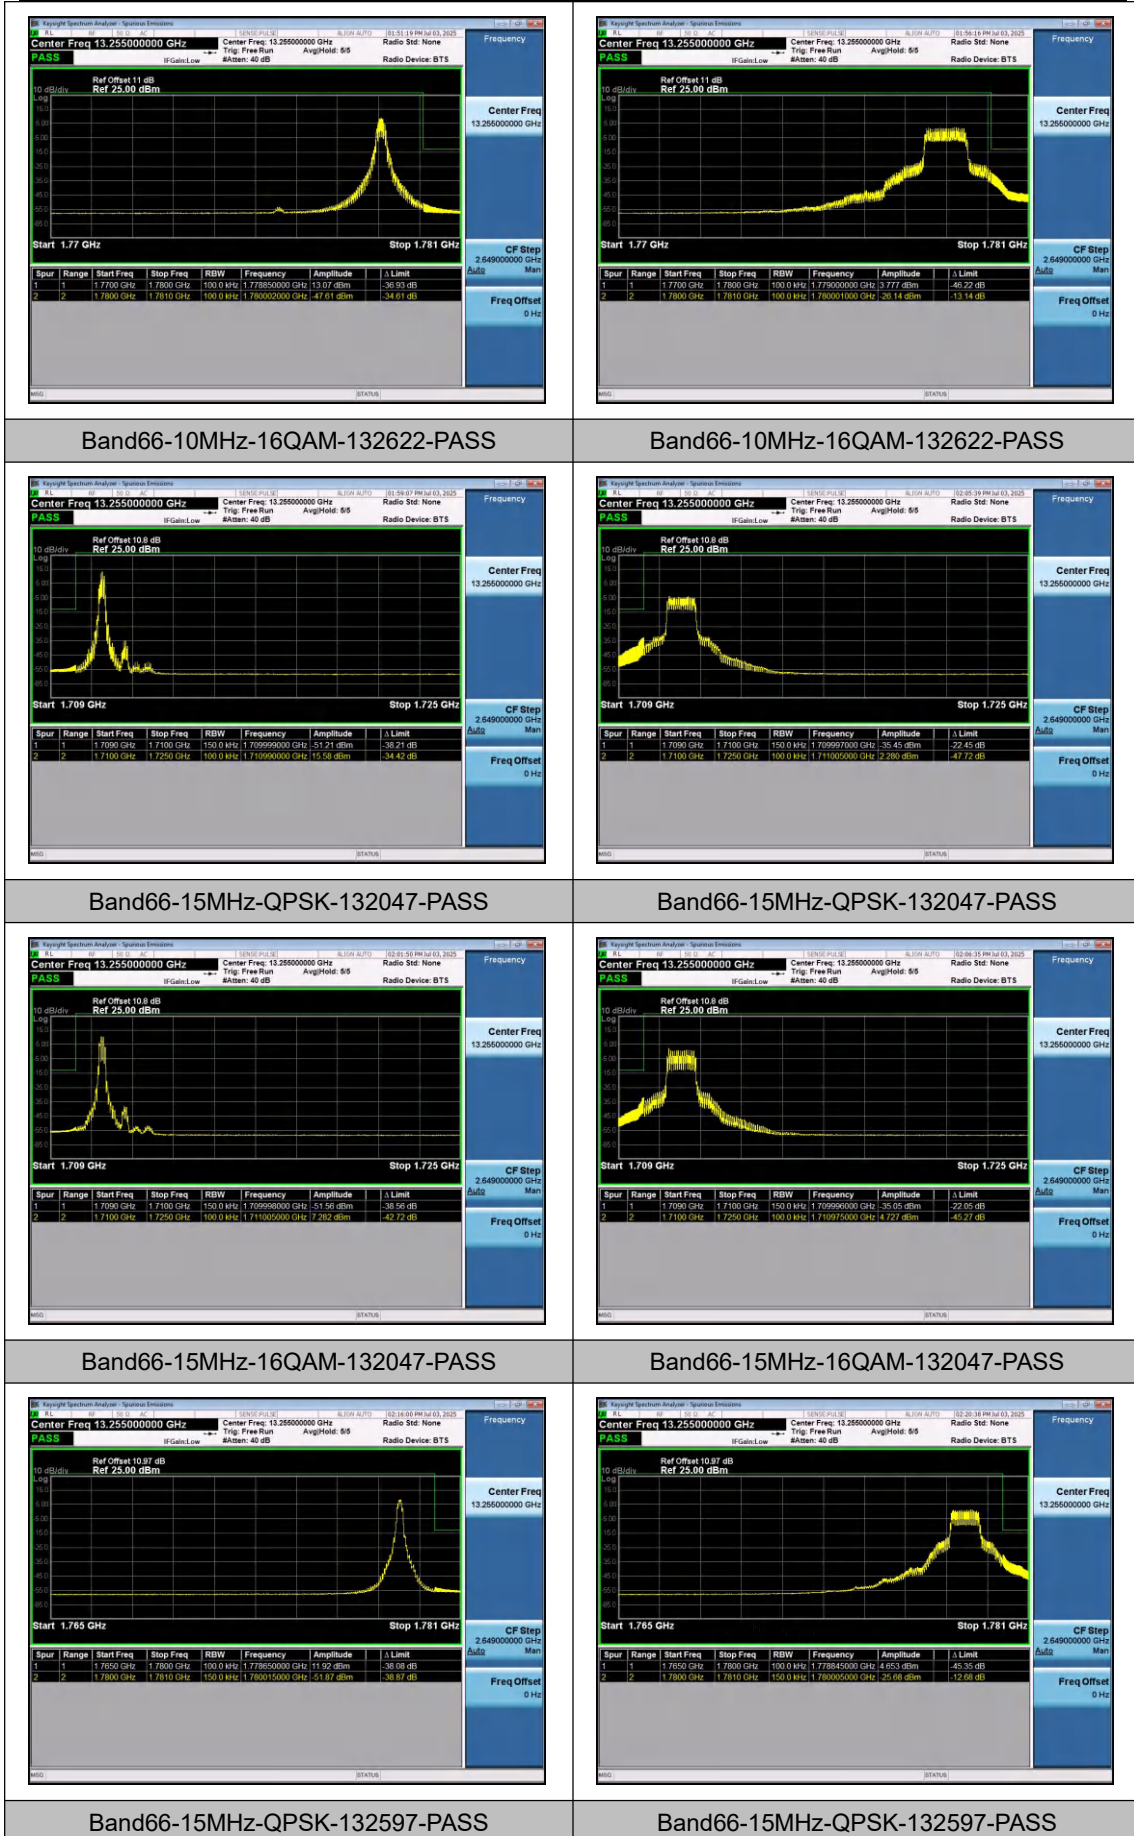

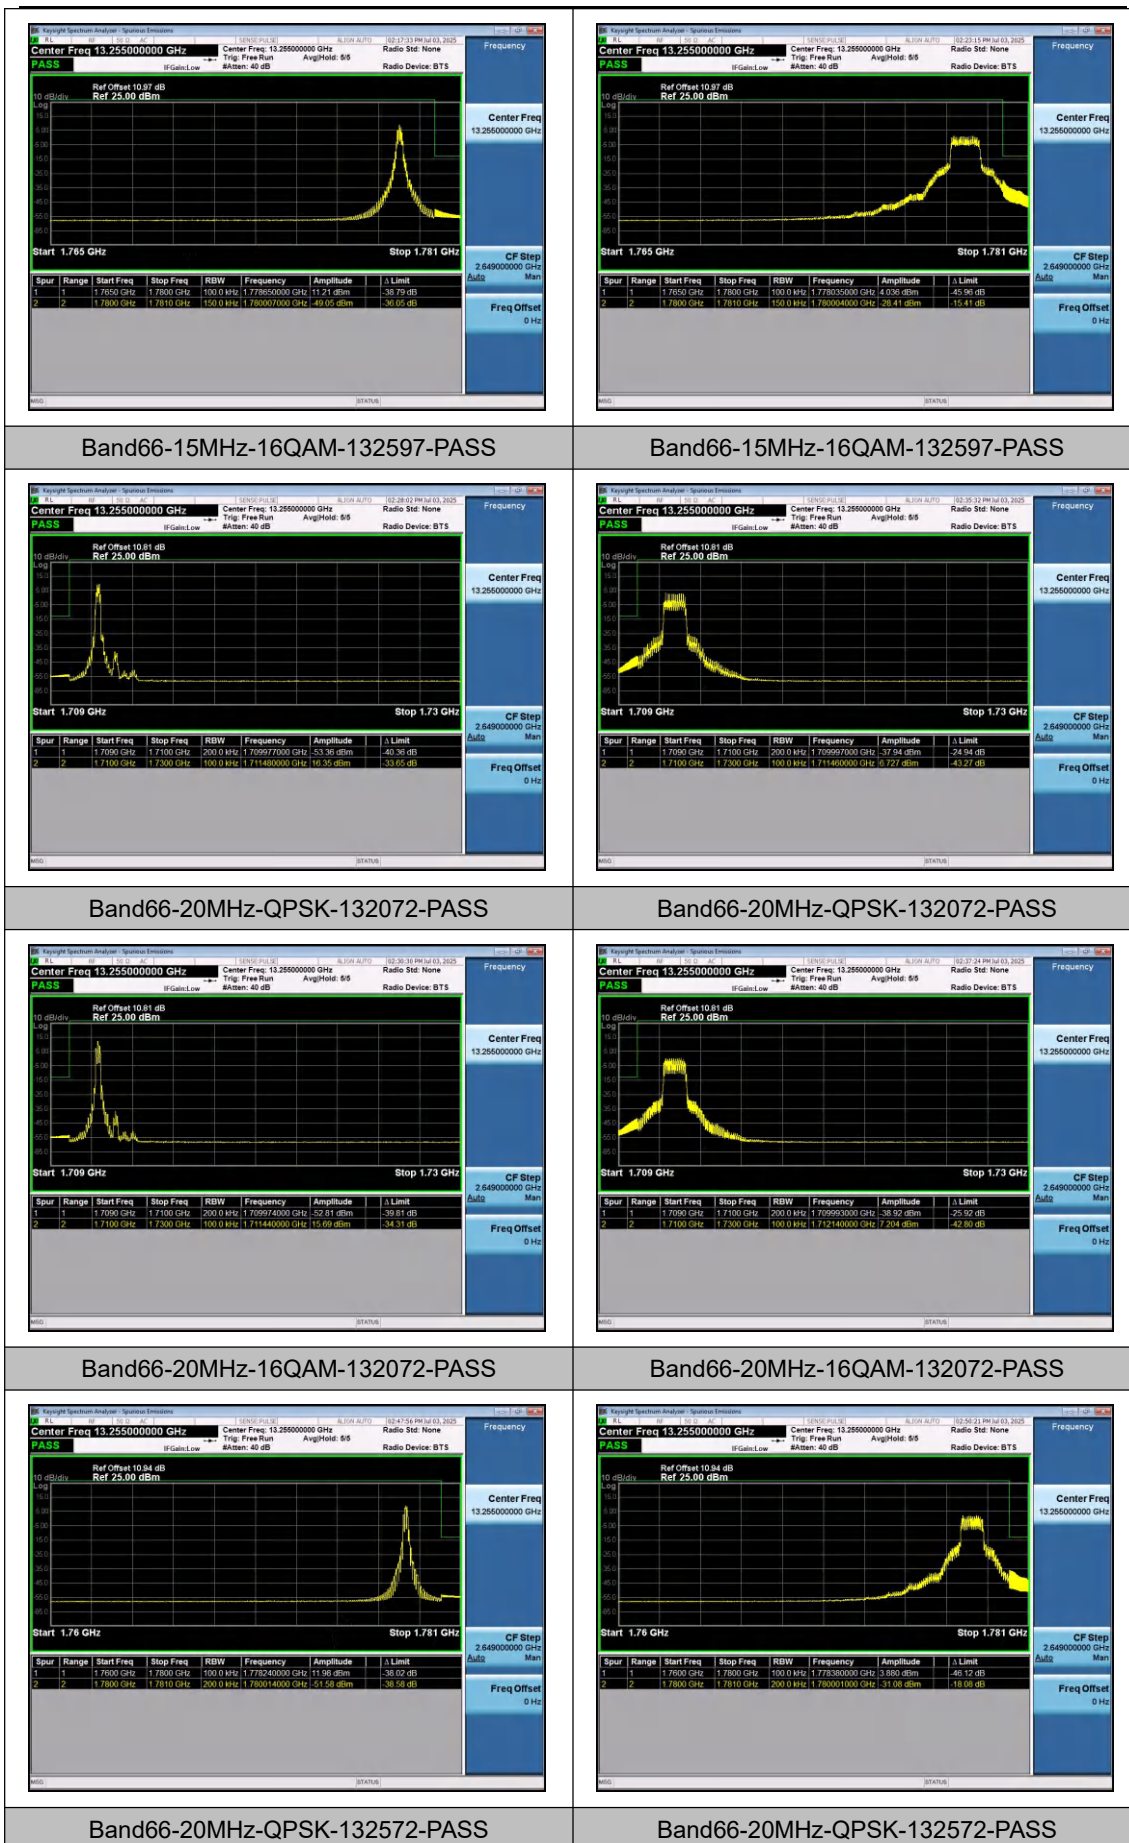

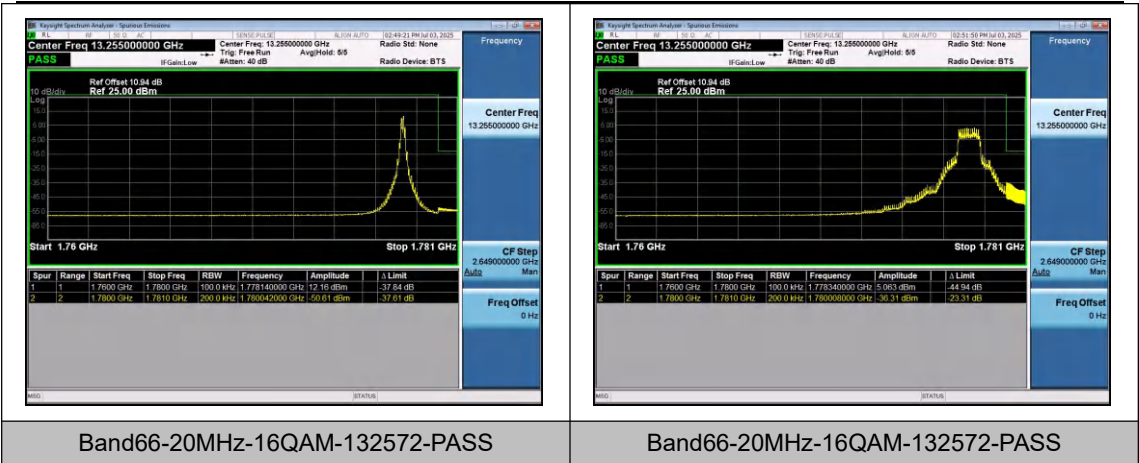

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix E: Conducted Spurious Emission for M1

Test Result

Band	Bandwidth	Modulation	Channel	RB Size	RB Start	NB Index	Start Freq	Stop Freq	Result (dBm)	Verdict
Band66	1.4MHz	QPSK	131979	1	0	Low	0.009	0.15	-73.34	PASS
Band66	1.4MHz	QPSK	131979	1	0	Low	0.15	30	-73.37	PASS
Band66	1.4MHz	QPSK	131979	1	0	Low	30	1000	-51.23	PASS
Band66	1.4MHz	QPSK	131979	1	0	Low	1000	20000	-41.69	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	0.009	0.15	-73.31	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	0.15	30	-73.2	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	30	1000	-51.21	PASS
Band66	1.4MHz	16QAM	131979	1	0	Low	1000	20000	-41.66	PASS
Band66	1.4MHz	QPSK	132322	1	0	Low	0.009	0.15	-73.72	PASS
Band66	1.4MHz	QPSK	132322	1	0	Low	0.15	30	-73.12	PASS
Band66	1.4MHz	QPSK	132322	1	0	Low	30	1000	-51.17	PASS
Band66	1.4MHz	QPSK	132322	1	0	Low	1000	20000	-41.2	PASS
Band66	1.4MHz	16QAM	132322	1	0	Low	0.009	0.15	-72.55	PASS
Band66	1.4MHz	16QAM	132322	1	0	Low	0.15	30	-76	PASS
Band66	1.4MHz	16QAM	132322	1	0	Low	30	1000	-51.15	PASS
Band66	1.4MHz	16QAM	132322	1	0	Low	1000	20000	-41.17	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	0.009	0.15	-73.48	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	0.15	30	-72.33	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	30	1000	-50.97	PASS
Band66	1.4MHz	QPSK	132665	1	5	High	1000	20000	-41.26	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	0.009	0.15	-72.83	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	0.15	30	-74.38	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	30	1000	-51.02	PASS
Band66	1.4MHz	16QAM	132665	1	5	High	1000	20000	-41.31	PASS
Band66	3MHz	QPSK	131987	1	0	Low	0.009	0.15	-72.45	PASS
Band66	3MHz	QPSK	131987	1	0	Low	0.15	30	-74.72	PASS
Band66	3MHz	QPSK	131987	1	0	Low	30	1000	-51.15	PASS
Band66	3MHz	QPSK	131987	1	0	Low	1000	20000	-41.44	PASS
Band66	3MHz	16QAM	131987	1	0	Low	0.009	0.15	-71.81	PASS
Band66	3MHz	16QAM	131987	1	0	Low	0.15	30	-74.67	PASS
Band66	3MHz	16QAM	131987	1	0	Low	30	1000	-51.23	PASS
Band66	3MHz	16QAM	131987	1	0	Low	1000	20000	-41.54	PASS
Band66	3MHz	QPSK	132322	1	0	Low	0.009	0.15	-73.84	PASS
Band66	3MHz	QPSK	132322	1	0	Low	0.15	30	-76.19	PASS
Band66	3MHz	QPSK	132322	1	0	Low	30	1000	-51.11	PASS
Band66	3MHz	QPSK	132322	1	0	Low	1000	20000	-41.61	PASS
Band66	3MHz	16QAM	132322	1	0	Low	0.009	0.15	-73.42	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	3MHz	16QAM	132322	1	0	Low	0.15	30	-73.09	PASS
Band66	3MHz	16QAM	132322	1	0	Low	30	1000	-51.11	PASS
Band66	3MHz	16QAM	132322	1	0	Low	1000	20000	-41.56	PASS
Band66	3MHz	QPSK	132657	1	5	High	0.009	0.15	-71.28	PASS
Band66	3MHz	QPSK	132657	1	5	High	0.15	30	-73.72	PASS
Band66	3MHz	QPSK	132657	1	5	High	30	1000	-50.98	PASS
Band66	3MHz	QPSK	132657	1	5	High	1000	20000	-41.1	PASS
Band66	3MHz	16QAM	132657	1	5	High	0.009	0.15	-72.06	PASS
Band66	3MHz	16QAM	132657	1	5	High	0.15	30	-73.05	PASS
Band66	3MHz	16QAM	132657	1	5	High	30	1000	-51.02	PASS
Band66	3MHz	16QAM	132657	1	5	High	1000	20000	-41.53	PASS
Band66	5MHz	QPSK	131997	1	0	Low	0.009	0.15	-72.3	PASS
Band66	5MHz	QPSK	131997	1	0	Low	0.15	30	-72.41	PASS
Band66	5MHz	QPSK	131997	1	0	Low	30	1000	-51.17	PASS
Band66	5MHz	QPSK	131997	1	0	Low	1000	20000	-40.94	PASS
Band66	5MHz	16QAM	131997	1	0	Low	0.009	0.15	-73.68	PASS
Band66	5MHz	16QAM	131997	1	0	Low	0.15	30	-72.93	PASS
Band66	5MHz	16QAM	131997	1	0	Low	30	1000	-51.13	PASS
Band66	5MHz	16QAM	131997	1	0	Low	1000	20000	-41.43	PASS
Band66	5MHz	QPSK	132322	1	0	Low	0.009	0.15	-72.79	PASS
Band66	5MHz	QPSK	132322	1	0	Low	0.15	30	-73.43	PASS
Band66	5MHz	QPSK	132322	1	0	Low	30	1000	-51.2	PASS
Band66	5MHz	QPSK	132322	1	0	Low	1000	20000	-41.62	PASS
Band66	5MHz	16QAM	132322	1	0	Low	0.009	0.15	-71.57	PASS
Band66	5MHz	16QAM	132322	1	0	Low	0.15	30	-76.16	PASS
Band66	5MHz	16QAM	132322	1	0	Low	30	1000	-51.24	PASS
Band66	5MHz	16QAM	132322	1	0	Low	1000	20000	-40.31	PASS
Band66	5MHz	QPSK	132647	1	5	High	0.009	0.15	-71.78	PASS
Band66	5MHz	QPSK	132647	1	5	High	0.15	30	-75.9	PASS
Band66	5MHz	QPSK	132647	1	5	High	30	1000	-50.97	PASS
Band66	5MHz	QPSK	132647	1	5	High	1000	20000	-41.01	PASS
Band66	5MHz	16QAM	132647	1	5	High	0.009	0.15	-73.69	PASS
Band66	5MHz	16QAM	132647	1	5	High	0.15	30	-73.61	PASS
Band66	5MHz	16QAM	132647	1	5	High	30	1000	-50.9	PASS
Band66	5MHz	16QAM	132647	1	5	High	1000	20000	-41.45	PASS
Band66	10MHz	QPSK	132022	1	0	Low	0.009	0.15	-74.91	PASS
Band66	10MHz	QPSK	132022	1	0	Low	0.15	30	-72.41	PASS
Band66	10MHz	QPSK	132022	1	0	Low	30	1000	-51.19	PASS
Band66	10MHz	QPSK	132022	1	0	Low	1000	20000	-41.77	PASS
Band66	10MHz	16QAM	132022	1	0	Low	0.009	0.15	-72.65	PASS
Band66	10MHz	16QAM	132022	1	0	Low	0.15	30	-72.75	PASS
Band66	10MHz	16QAM	132022	1	0	Low	30	1000	-51.14	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Band66	10MHz	16QAM	132022	1	0	Low	1000	20000	-41.48	PASS
Band66	10MHz	QPSK	132322	1	0	Low	0.009	0.15	-72.78	PASS
Band66	10MHz	QPSK	132322	1	0	Low	0.15	30	-73.26	PASS
Band66	10MHz	QPSK	132322	1	0	Low	30	1000	-51.07	PASS
Band66	10MHz	QPSK	132322	1	0	Low	1000	20000	-41.42	PASS
Band66	10MHz	16QAM	132322	1	0	Low	0.009	0.15	-70.37	PASS
Band66	10MHz	16QAM	132322	1	0	Low	0.15	30	-73.55	PASS
Band66	10MHz	16QAM	132322	1	0	Low	30	1000	-51.17	PASS
Band66	10MHz	16QAM	132322	1	0	Low	1000	20000	-41.41	PASS
Band66	10MHz	QPSK	132622	1	5	High	0.009	0.15	-71.92	PASS
Band66	10MHz	QPSK	132622	1	5	High	0.15	30	-72.86	PASS
Band66	10MHz	QPSK	132622	1	5	High	30	1000	-50.86	PASS
Band66	10MHz	QPSK	132622	1	5	High	1000	20000	-41.48	PASS
Band66	10MHz	16QAM	132622	1	5	High	0.009	0.15	-72.82	PASS
Band66	10MHz	16QAM	132622	1	5	High	0.15	30	-74.04	PASS
Band66	10MHz	16QAM	132622	1	5	High	30	1000	-50.99	PASS
Band66	10MHz	16QAM	132622	1	5	High	1000	20000	-41.41	PASS
Band66	15MHz	QPSK	132047	1	0	Low	0.009	0.15	-73.07	PASS
Band66	15MHz	QPSK	132047	1	0	Low	0.15	30	-73.88	PASS
Band66	15MHz	QPSK	132047	1	0	Low	30	1000	-51.12	PASS
Band66	15MHz	QPSK	132047	1	0	Low	1000	20000	-41.7	PASS
Band66	15MHz	16QAM	132047	1	0	Low	0.009	0.15	-71.93	PASS
Band66	15MHz	16QAM	132047	1	0	Low	0.15	30	-72.38	PASS
Band66	15MHz	16QAM	132047	1	0	Low	30	1000	-51.1	PASS
Band66	15MHz	16QAM	132047	1	0	Low	1000	20000	-41.6	PASS
Band66	15MHz	QPSK	132322	1	0	Low	0.009	0.15	-74.43	PASS
Band66	15MHz	QPSK	132322	1	0	Low	0.15	30	-73.19	PASS
Band66	15MHz	QPSK	132322	1	0	Low	30	1000	-51.12	PASS
Band66	15MHz	QPSK	132322	1	0	Low	1000	20000	-40.51	PASS
Band66	15MHz	16QAM	132322	1	0	Low	0.009	0.15	-72.98	PASS
Band66	15MHz	16QAM	132322	1	0	Low	0.15	30	-72.93	PASS
Band66	15MHz	16QAM	132322	1	0	Low	30	1000	-51.19	PASS
Band66	15MHz	16QAM	132322	1	0	Low	1000	20000	-41.14	PASS
Band66	15MHz	QPSK	132597	1	5	High	0.009	0.15	-71.87	PASS
Band66	15MHz	QPSK	132597	1	5	High	0.15	30	-73.62	PASS
Band66	15MHz	QPSK	132597	1	5	High	30	1000	-50.92	PASS
Band66	15MHz	QPSK	132597	1	5	High	1000	20000	-41.55	PASS
Band66	15MHz	16QAM	132597	1	5	High	0.009	0.15	-73.26	PASS
Band66	15MHz	16QAM	132597	1	5	High	0.15	30	-76.46	PASS
Band66	15MHz	16QAM	132597	1	5	High	30	1000	-51.05	PASS
Band66	15MHz	16QAM	132597	1	5	High	1000	20000	-41.22	PASS
Band66	20MHz	QPSK	132072	1	0	Low	0.009	0.15	-72.51	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com