


**Shenzhen Anbotek Compliance Laboratory Limited**

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com

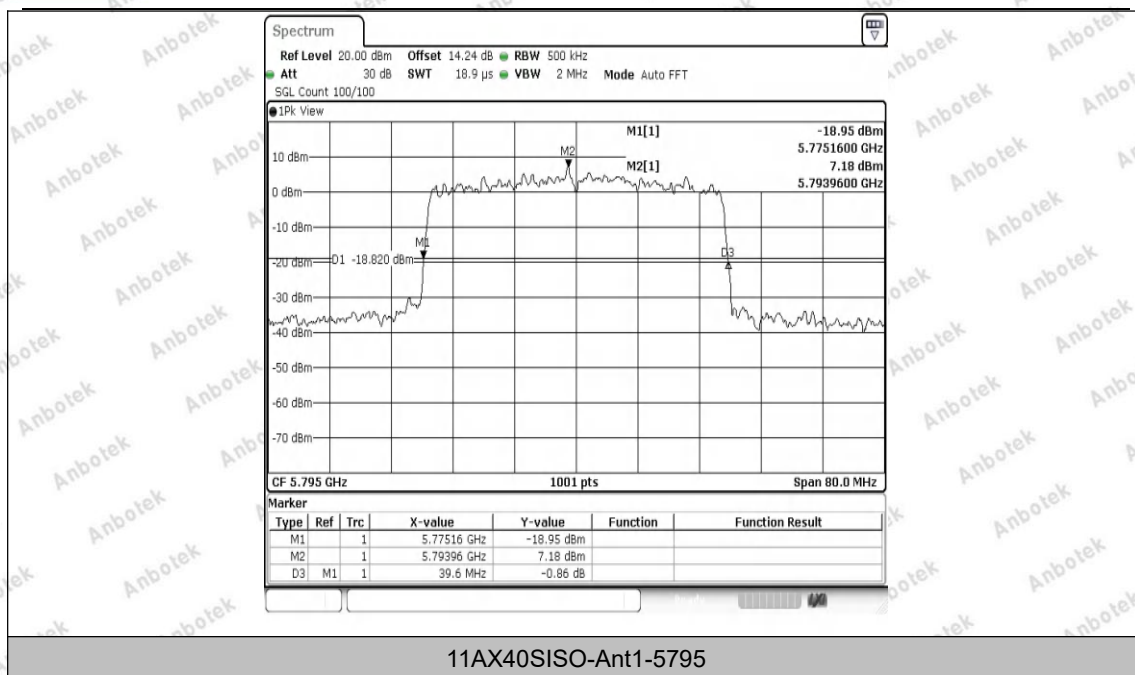

Appendix A2: Occupied channel bandwidth

Test Result

TestMode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.823	5171.4486	5188.2717	---	---
11A	Ant1	5200	16.823	5191.4885	5208.3117	---	---
11A	Ant1	5240	16.623	5231.6883	5248.3117	---	---
11A	Ant1	5260	16.903	5251.4486	5268.3516	---	---
11A	Ant1	5280	16.583	5271.6484	5288.2318	---	---
11A	Ant1	5320	16.863	5311.5684	5328.4316	---	---
11A	Ant1	5500	16.703	5491.5285	5508.2318	---	---
11A	Ant1	5580	16.943	5571.4885	5588.4316	---	---
11A	Ant1	5700	16.943	5691.4486	5708.3916	---	---
11A	Ant1	5745	16.663	5736.6084	5753.2717	---	---
11A	Ant1	5785	17.183	5776.5285	5793.7113	---	---
11A	Ant1	5825	16.863	5816.4486	5833.3117	---	---
11N20SISO	Ant1	5180	17.862	5171.0090	5188.8711	---	---
11N20SISO	Ant1	5200	17.942	5191.0090	5208.9510	---	---
11N20SISO	Ant1	5240	17.742	5231.0889	5248.8312	---	---
11N20SISO	Ant1	5260	17.862	5250.8891	5268.7512	---	---
11N20SISO	Ant1	5280	17.702	5271.0490	5288.7512	---	---
11N20SISO	Ant1	5320	17.702	5311.0889	5328.7912	---	---
11N20SISO	Ant1	5500	17.662	5491.0889	5508.7512	---	---
11N20SISO	Ant1	5580	17.822	5570.9690	5588.7912	---	---
11N20SISO	Ant1	5700	17.742	5691.0889	5708.8312	---	---
11N20SISO	Ant1	5745	17.782	5736.0090	5753.7912	---	---
11N20SISO	Ant1	5785	17.862	5776.0090	5793.8711	---	---
11N20SISO	Ant1	5825	17.862	5815.8891	5833.7512	---	---
11N40SISO	Ant1	5190	36.204	5171.9381	5208.1419	---	---
11N40SISO	Ant1	5230	36.124	5211.7782	5247.9021	---	---
11N40SISO	Ant1	5270	36.044	5252.0180	5288.0619	---	---
11N40SISO	Ant1	5310	36.124	5291.7782	5327.9021	---	---
11N40SISO	Ant1	5510	36.124	5491.7782	5527.9021	---	---
11N40SISO	Ant1	5550	36.444	5531.8581	5568.3017	---	---
11N40SISO	Ant1	5670	35.884	5651.9381	5687.8222	---	---
11N40SISO	Ant1	5755	36.044	5736.8581	5772.9021	---	---
11N40SISO	Ant1	5795	35.804	5777.0979	5812.9021	---	---
11AC20SISO	Ant1	5180	17.862	5170.9291	5188.7912	---	---
11AC20SISO	Ant1	5200	17.862	5191.1289	5208.9910	---	---
11AC20SISO	Ant1	5240	17.862	5230.9690	5248.8312	---	---
11AC20SISO	Ant1	5260	17.782	5251.0090	5268.7912	---	---

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



11AC20SISO	Ant1	5280	17.862	5270.9690	5288.8312	---	---
11AC20SISO	Ant1	5320	17.702	5311.0889	5328.7912	---	---
11AC20SISO	Ant1	5500	17.942	5490.9291	5508.8711	---	---
11AC20SISO	Ant1	5580	17.782	5571.0490	5588.8312	---	---
11AC20SISO	Ant1	5700	17.862	5690.9690	5708.8312	---	---
11AC20SISO	Ant1	5745	17.742	5736.0490	5753.7912	---	---
11AC20SISO	Ant1	5785	17.942	5775.9291	5793.8711	---	---
11AC20SISO	Ant1	5825	17.862	5816.0090	5833.8711	---	---
11AC40SISO	Ant1	5190	35.964	5171.9381	5207.9021	---	---
11AC40SISO	Ant1	5230	36.284	5212.0180	5248.3017	---	---
11AC40SISO	Ant1	5270	35.884	5251.9381	5287.8222	---	---
11AC40SISO	Ant1	5310	36.204	5291.6983	5327.9021	---	---
11AC40SISO	Ant1	5510	36.044	5491.8581	5527.9021	---	---
11AC40SISO	Ant1	5550	36.124	5531.7782	5567.9021	---	---
11AC40SISO	Ant1	5670	35.964	5652.0180	5687.9820	---	---
11AC40SISO	Ant1	5755	36.124	5736.7782	5772.9021	---	---
11AC40SISO	Ant1	5795	36.124	5776.8581	5812.9820	---	---
11AX20SISO	Ant1	5180	18.781	5170.5694	5189.3506	---	---
11AX20SISO	Ant1	5200	18.821	5190.5694	5209.3906	---	---
11AX20SISO	Ant1	5240	18.901	5230.4895	5249.3906	---	---
11AX20SISO	Ant1	5260	18.901	5250.4895	5269.3906	---	---
11AX20SISO	Ant1	5280	18.781	5270.5295	5289.3107	---	---
11AX20SISO	Ant1	5320	18.861	5310.5295	5329.3906	---	---
11AX20SISO	Ant1	5500	18.821	5490.5295	5509.3506	---	---
11AX20SISO	Ant1	5580	18.621	5570.6494	5589.2707	---	---
11AX20SISO	Ant1	5700	18.821	5690.4895	5709.3107	---	---
11AX20SISO	Ant1	5745	18.821	5735.5295	5754.3506	---	---
11AX20SISO	Ant1	5785	18.821	5775.5295	5794.3506	---	---
11AX20SISO	Ant1	5825	18.821	5815.4895	5834.3107	---	---
11AX40SISO	Ant1	5190	37.722	5171.2987	5209.0210	---	---
11AX40SISO	Ant1	5230	37.562	5211.1389	5248.7013	---	---
11AX40SISO	Ant1	5270	37.642	5251.1389	5288.7812	---	---
11AX40SISO	Ant1	5310	37.642	5291.0589	5328.7013	---	---
11AX40SISO	Ant1	5510	37.722	5490.8991	5528.6214	---	---
11AX40SISO	Ant1	5550	37.802	5530.9790	5568.7812	---	---
11AX40SISO	Ant1	5670	37.642	5651.1389	5688.7812	---	---
11AX40SISO	Ant1	5755	37.802	5735.9790	5773.7812	---	---
11AX40SISO	Ant1	5795	37.562	5776.1389	5813.7013	---	---

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China,
 Tel: (86)0755-26066440 Email: service@anbotek.com




Hotline
 400-003-0500
www.anbotek.com




Test Graphs

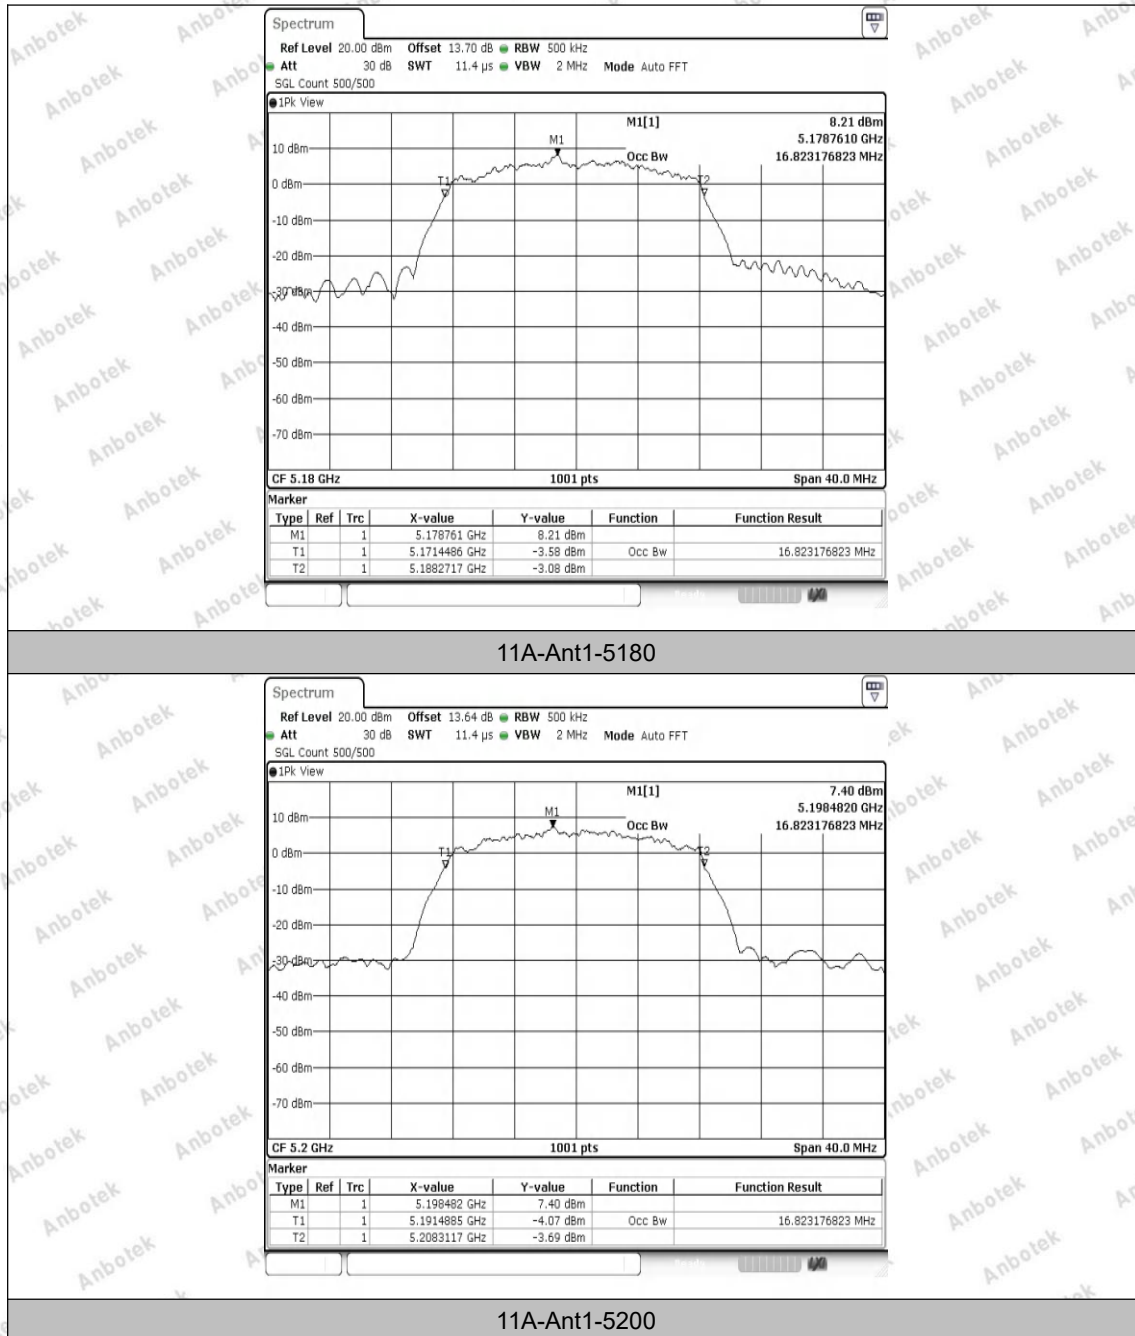

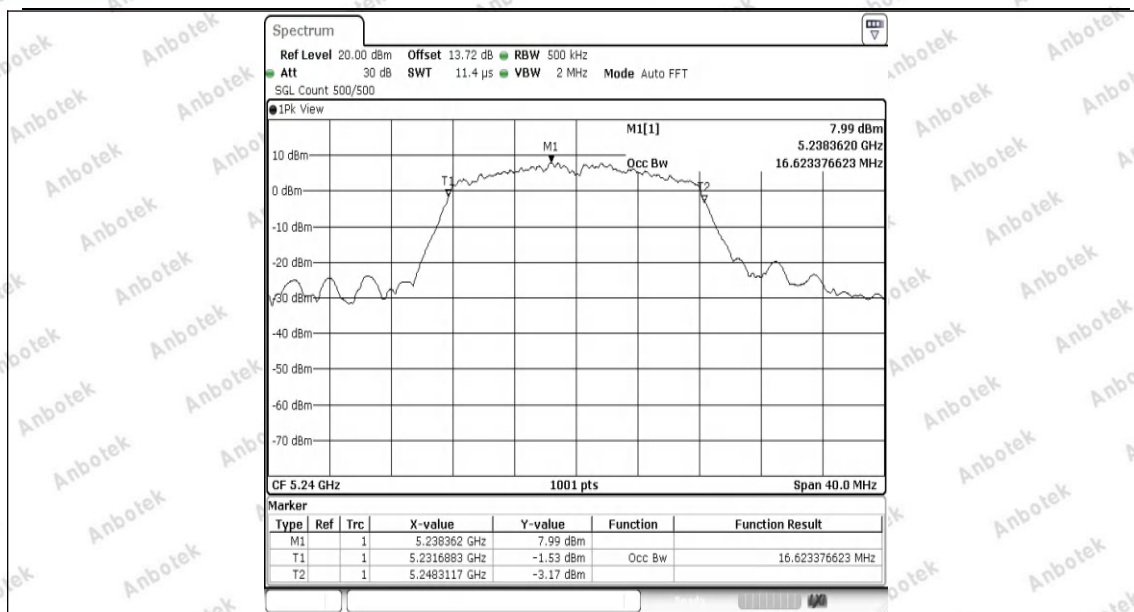


11A-Ant1-5240

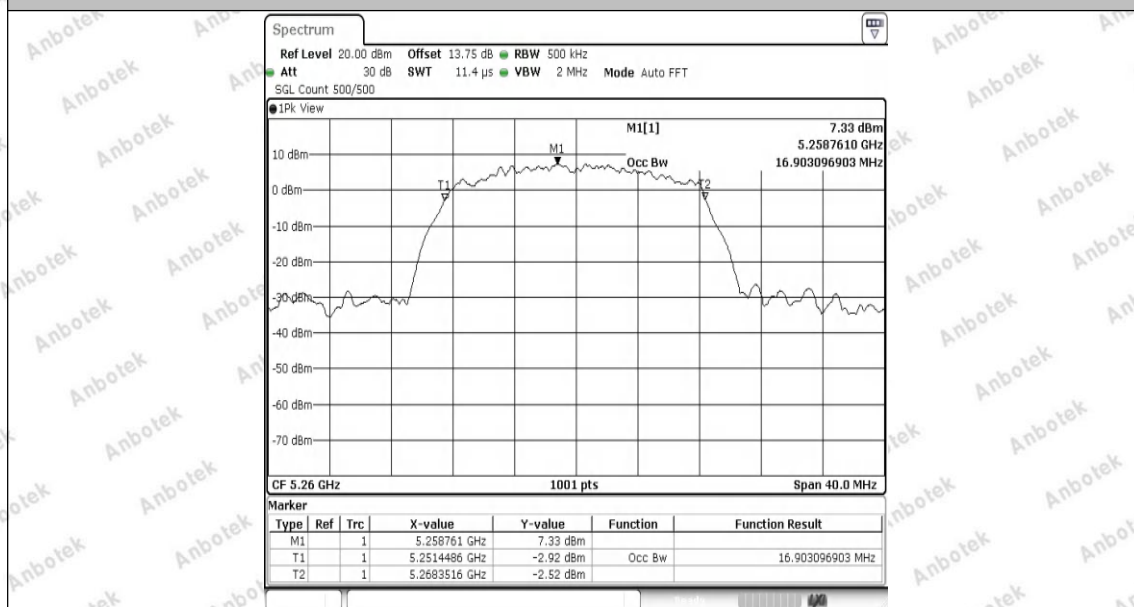


11A-Ant1-5260



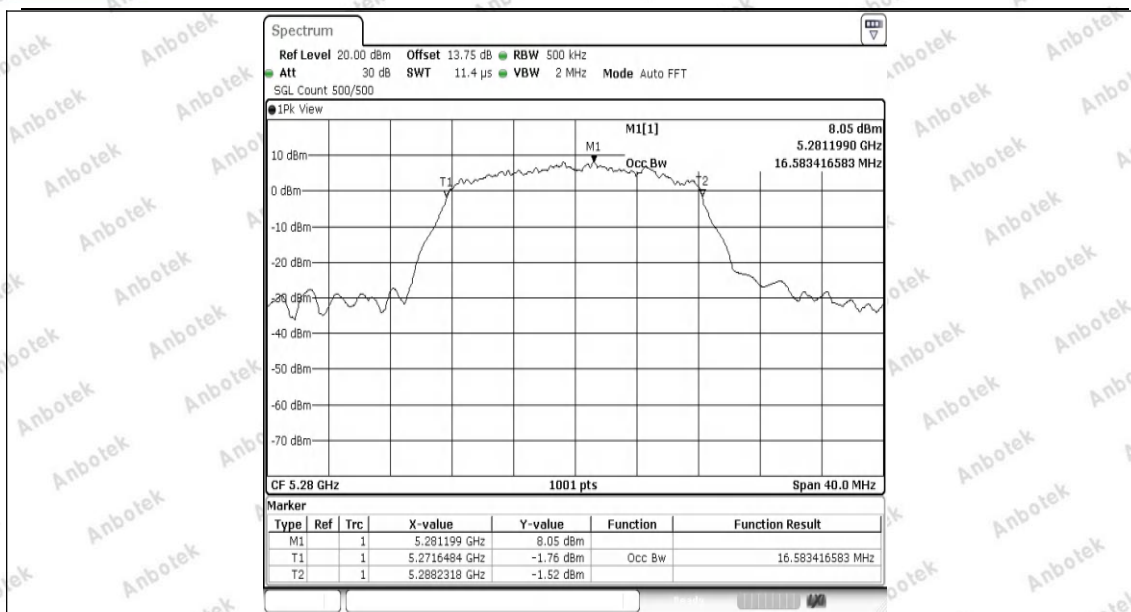


11A-Ant1-5280

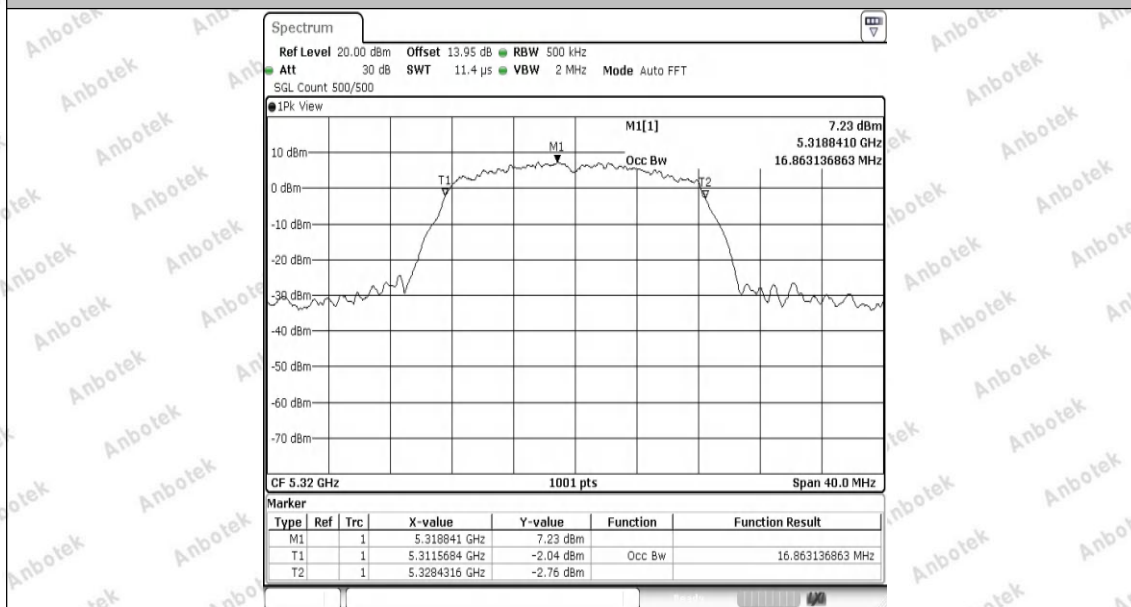


11A-Ant1-5320



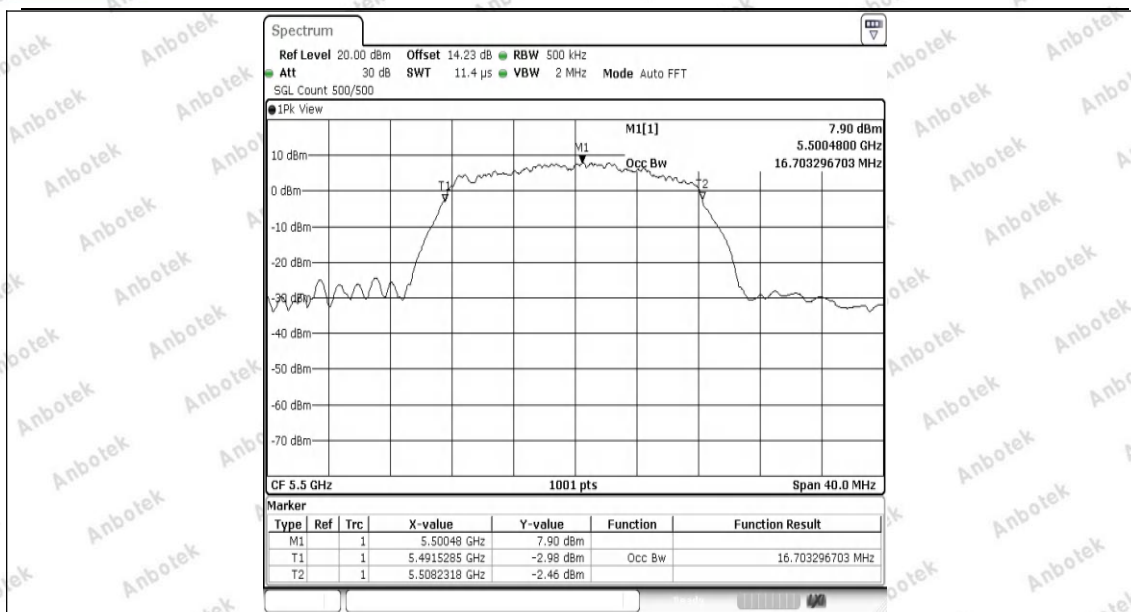


11A-Ant1-5500

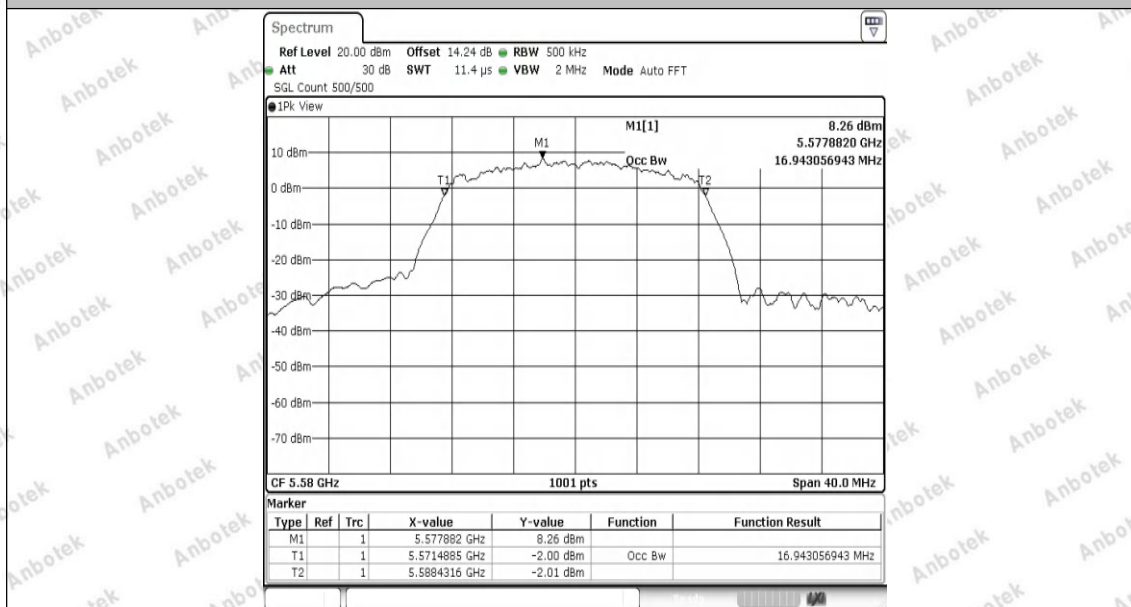


11A-Ant1-5580



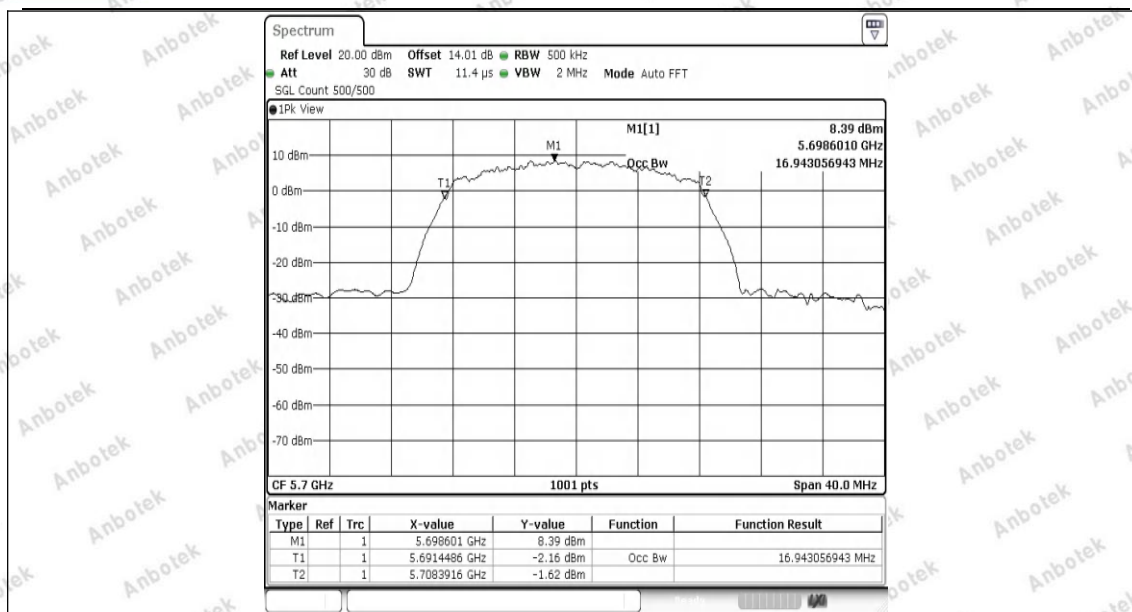


11A-Ant1-5700

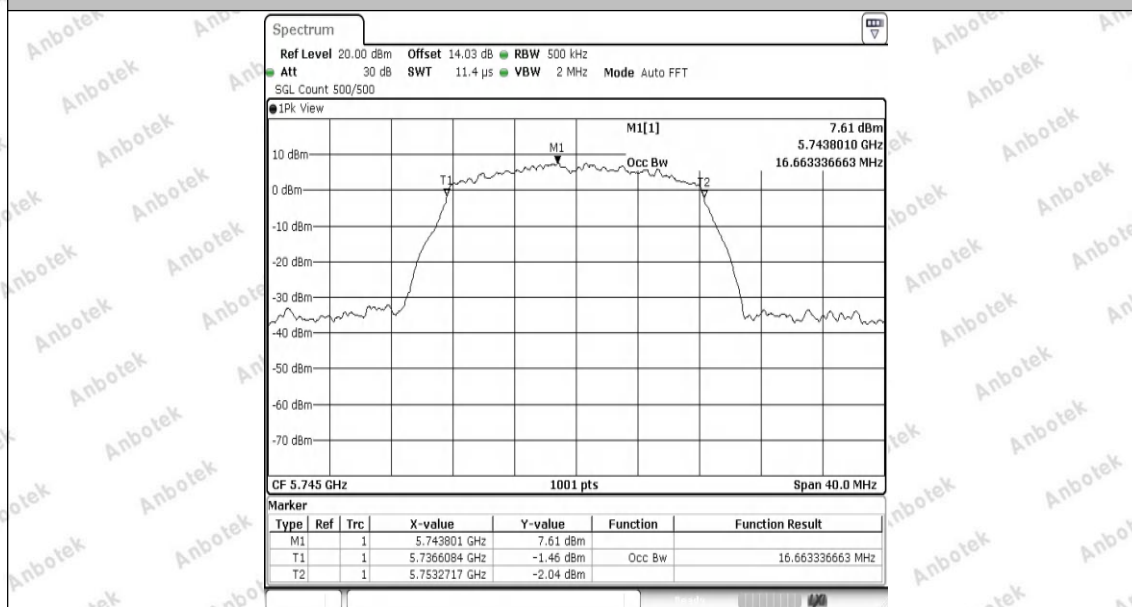


11A-Ant1-5745



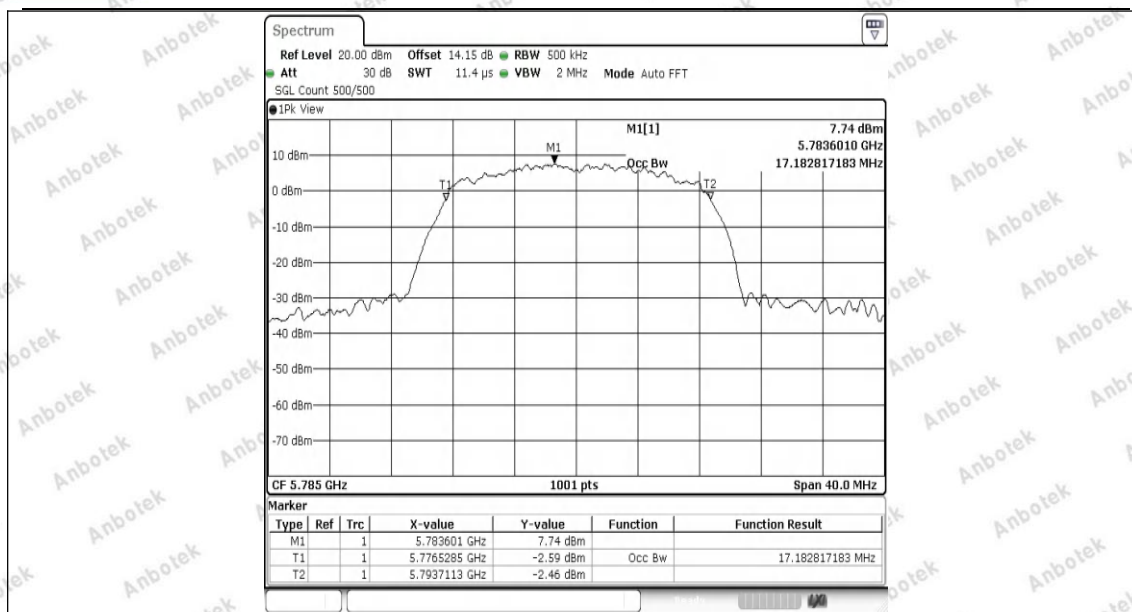



11A-Ant1-5785

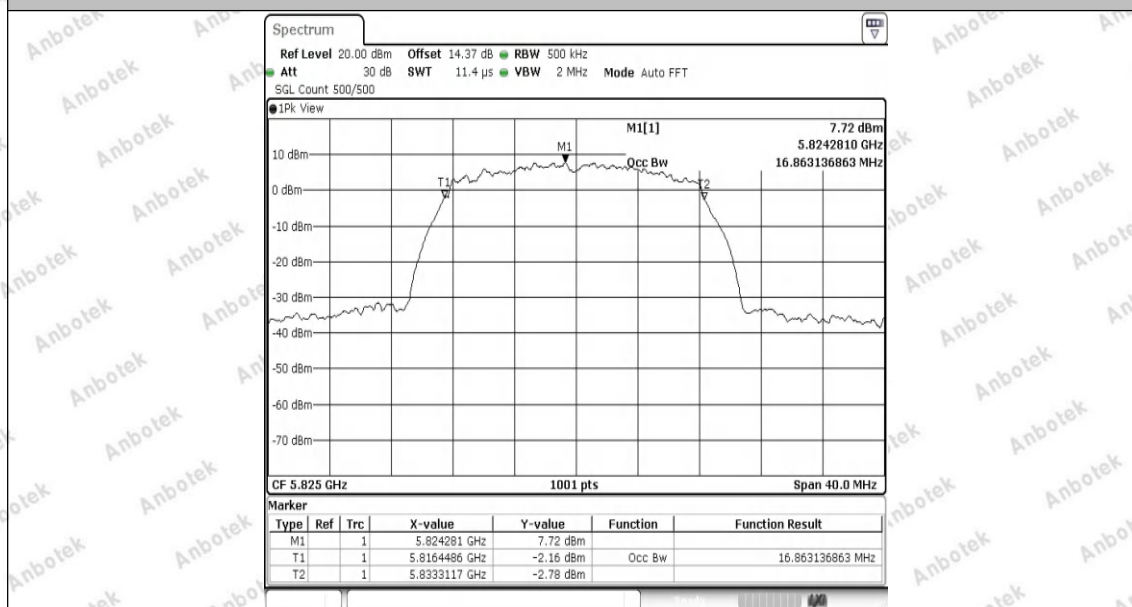


11A-Ant1-5825




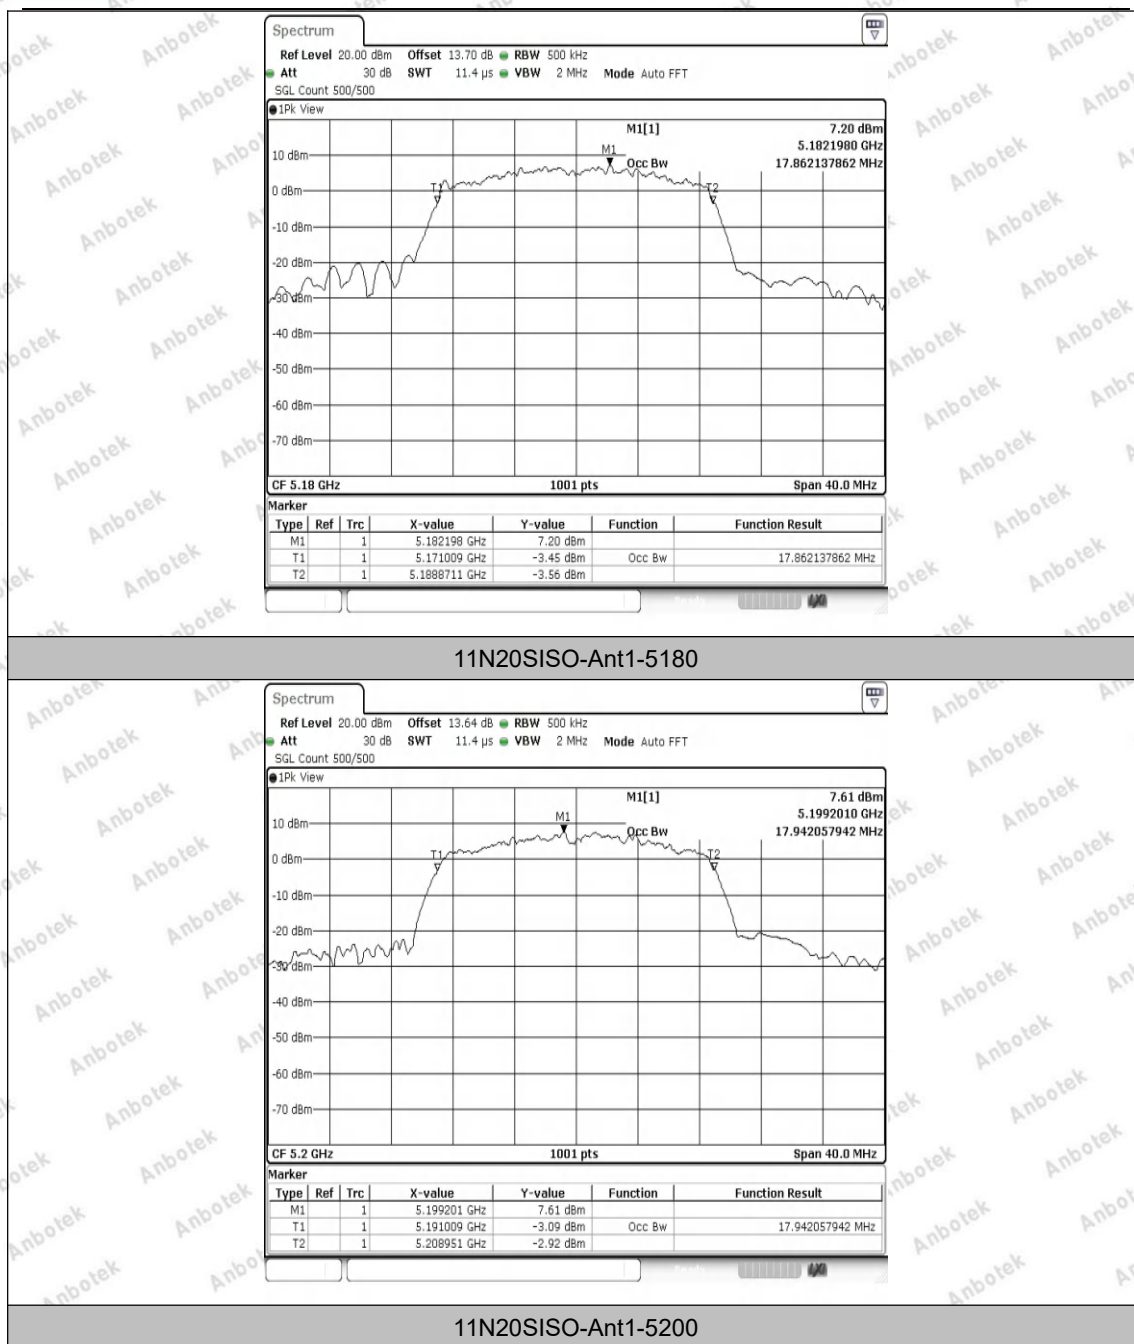

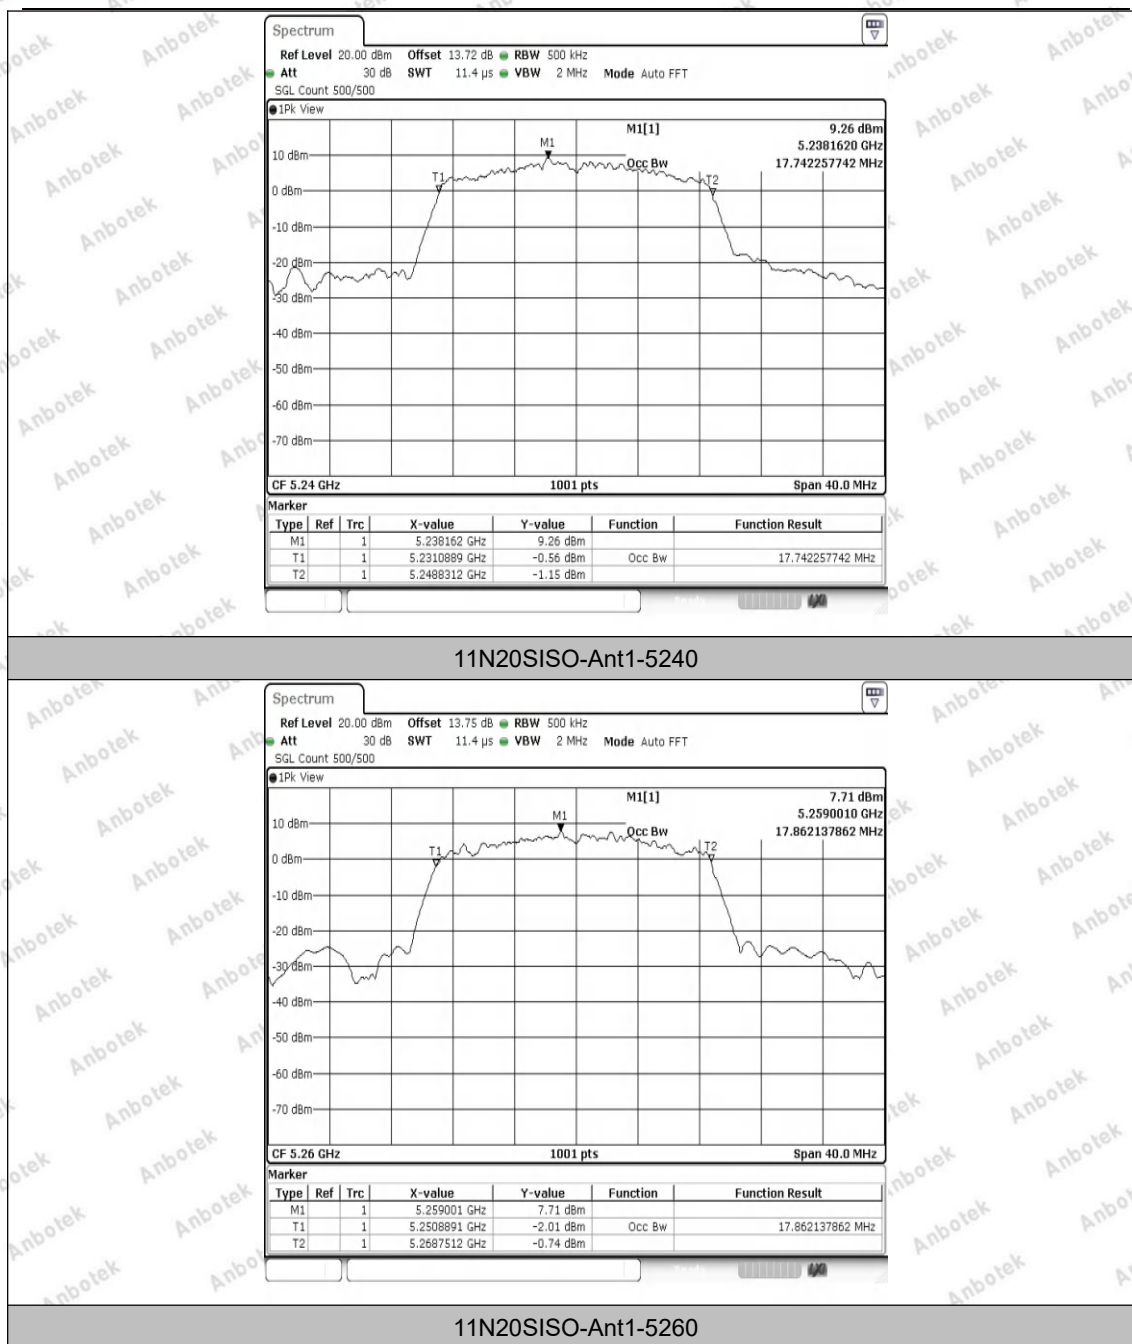

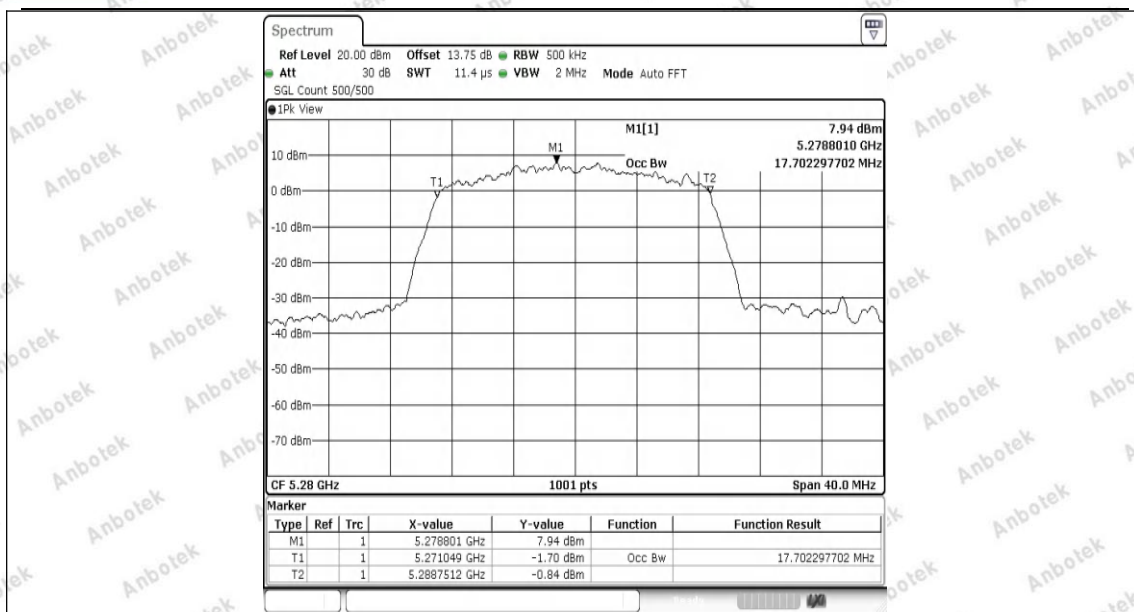


11N20SISO-Ant1-5280

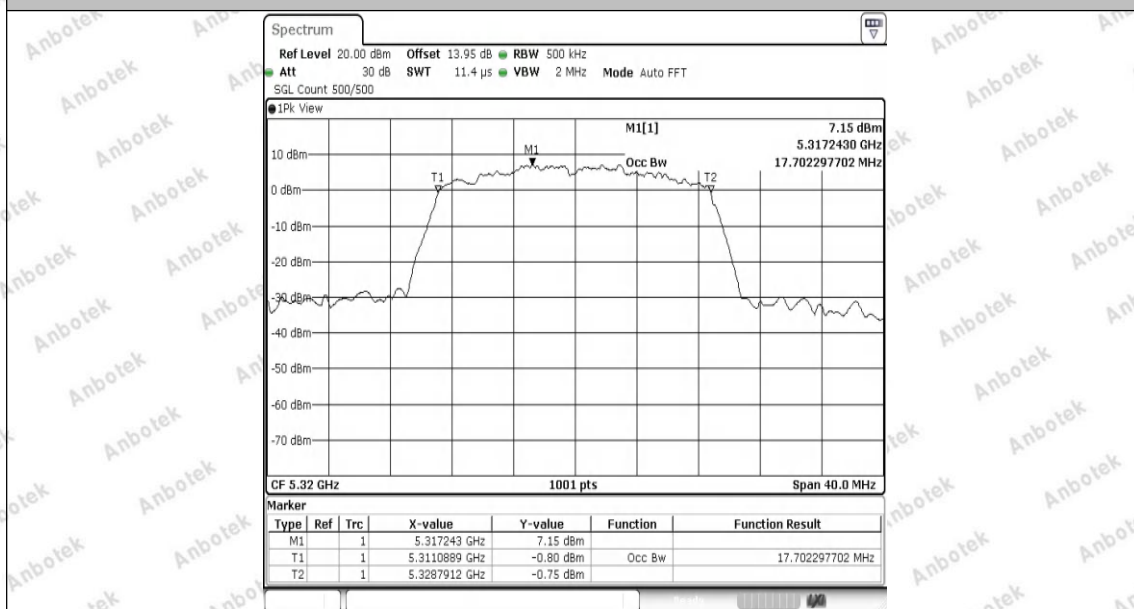


11N20SISO-Ant1-5320



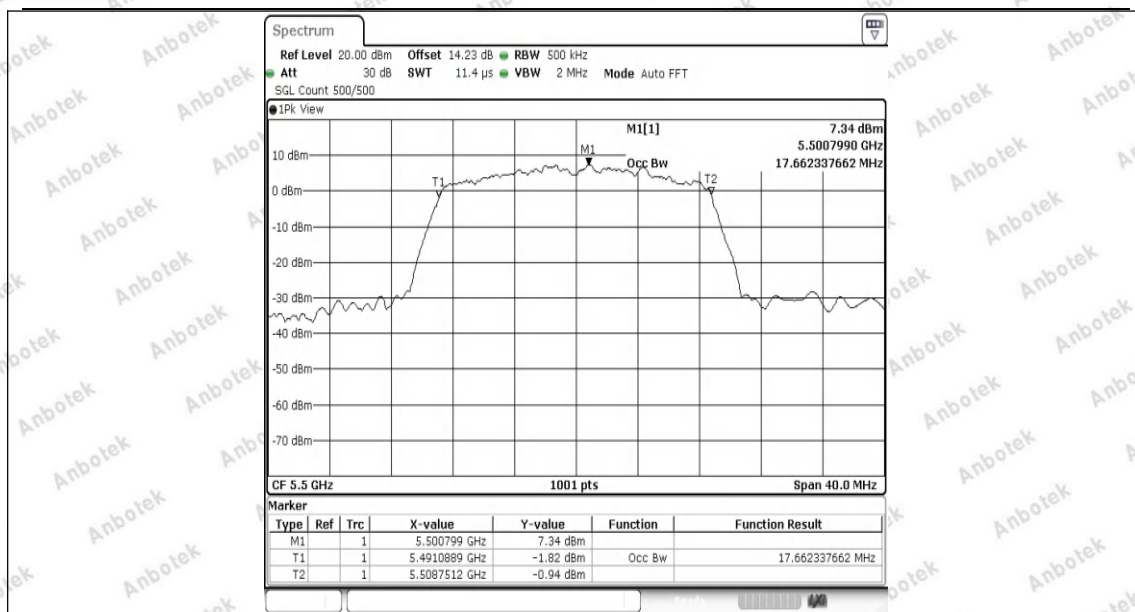


11N20SISO-Ant1-5500

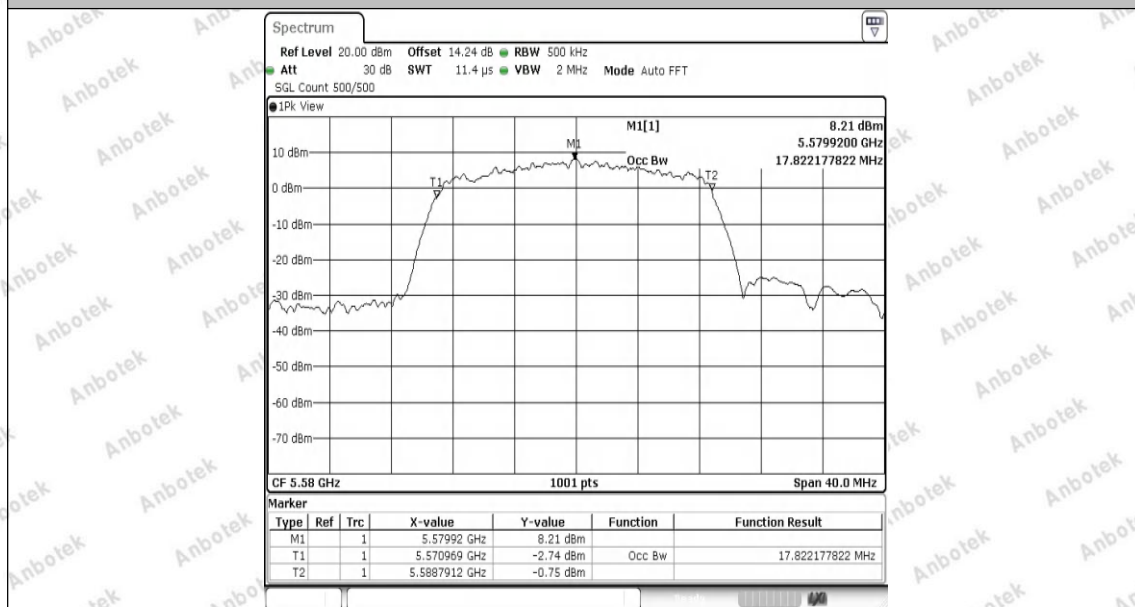


11N20SISO-Ant1-5580



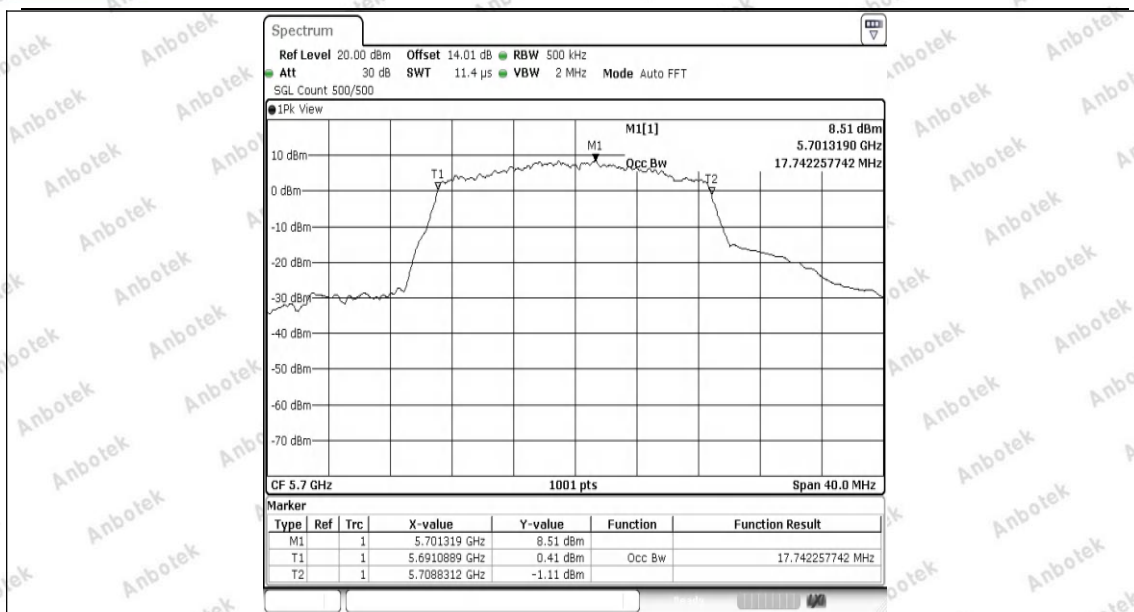


11N20SISO-Ant1-5700

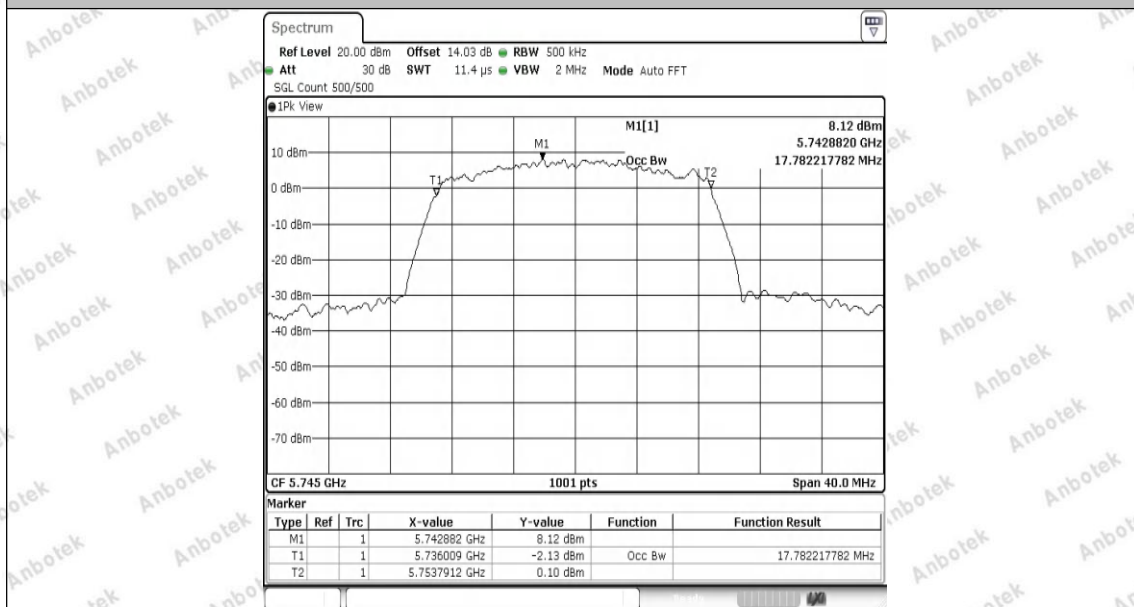


11N20SISO-Ant1-5745





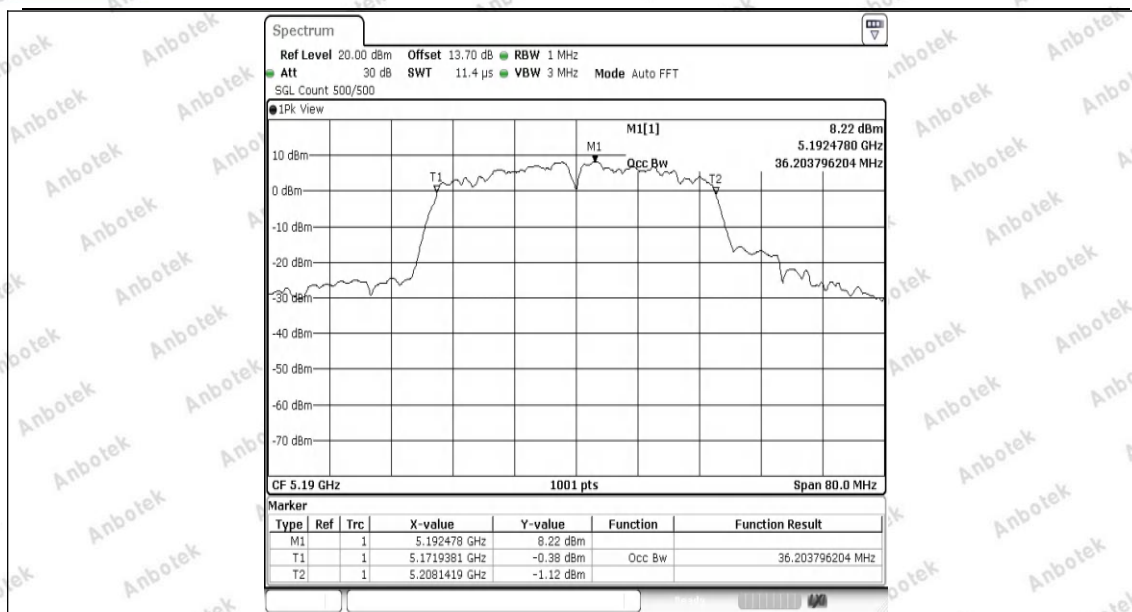


11N40SISO-Ant1-5190

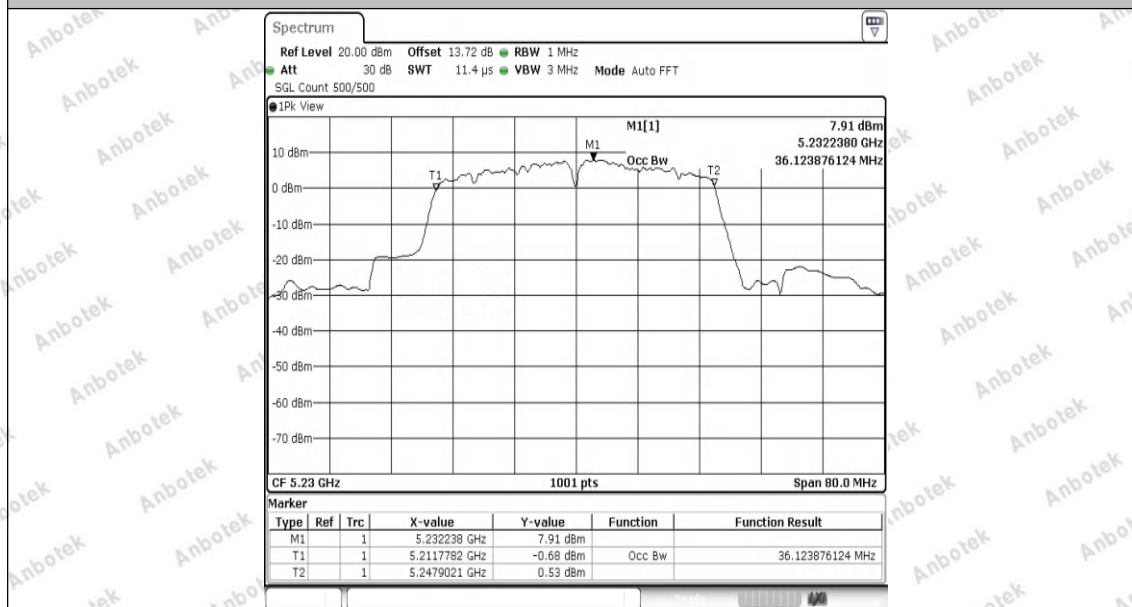


11N40SISO-Ant1-5230



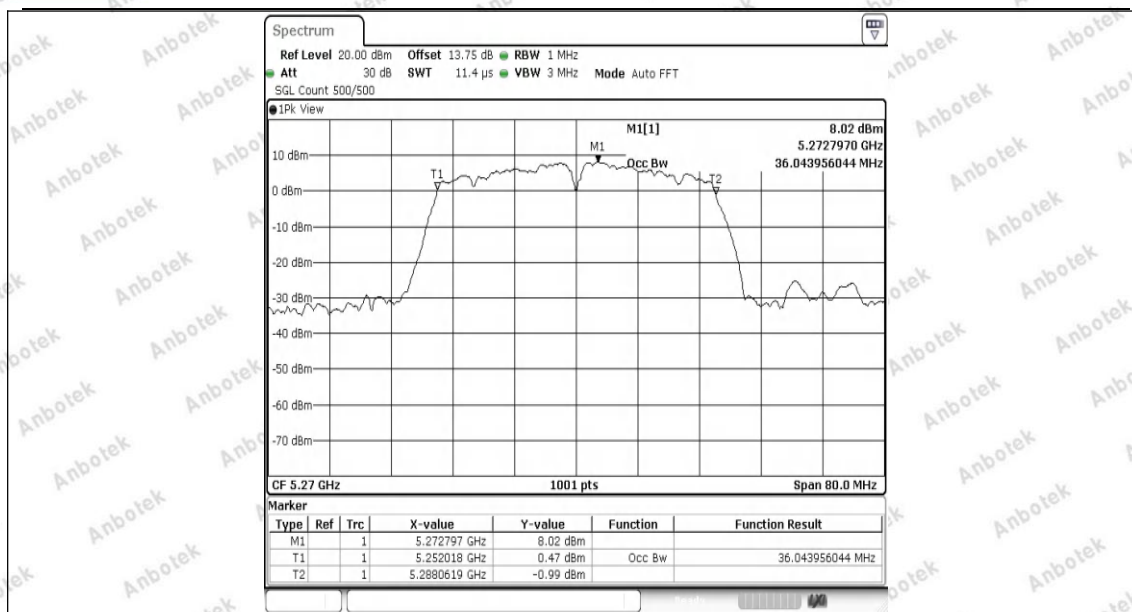


11N40SISO-Ant1-5270

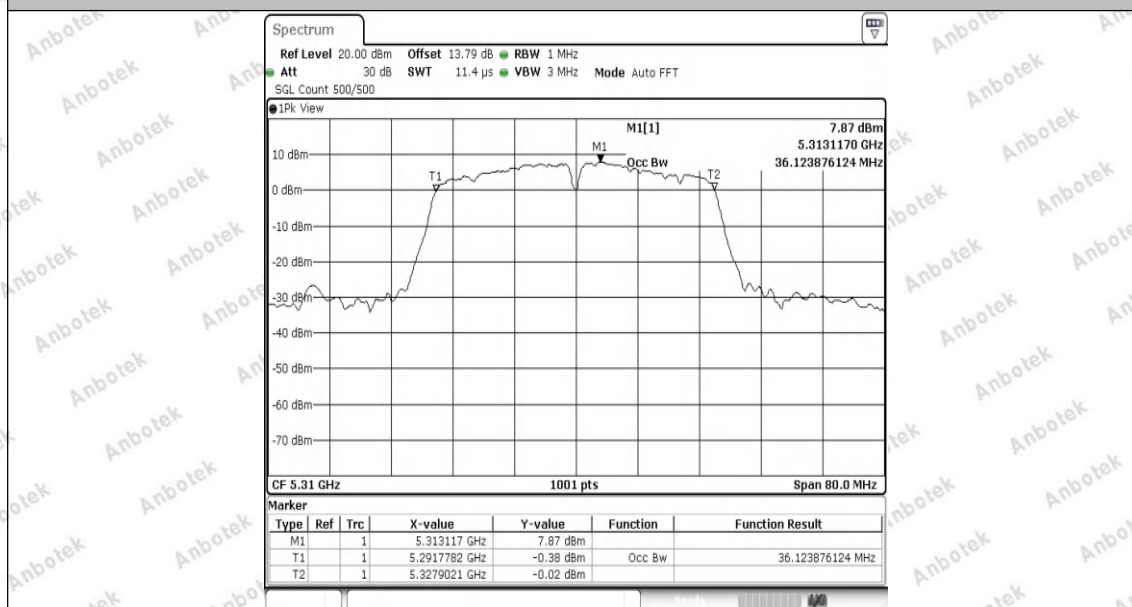


11N40SISO-Ant1-5310



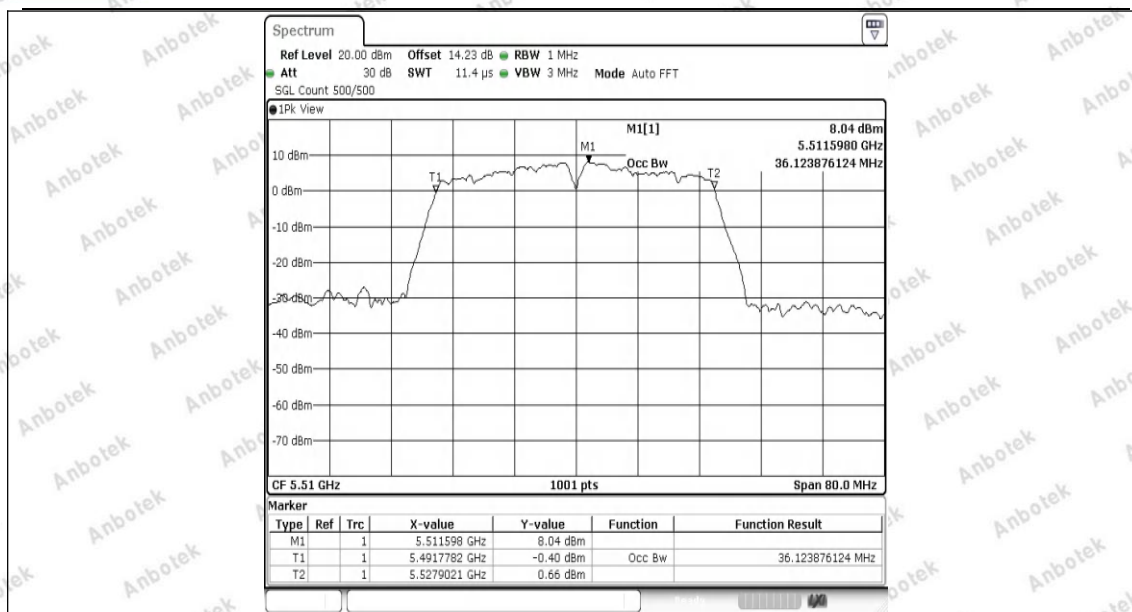


11N40SISO-Ant1-5510

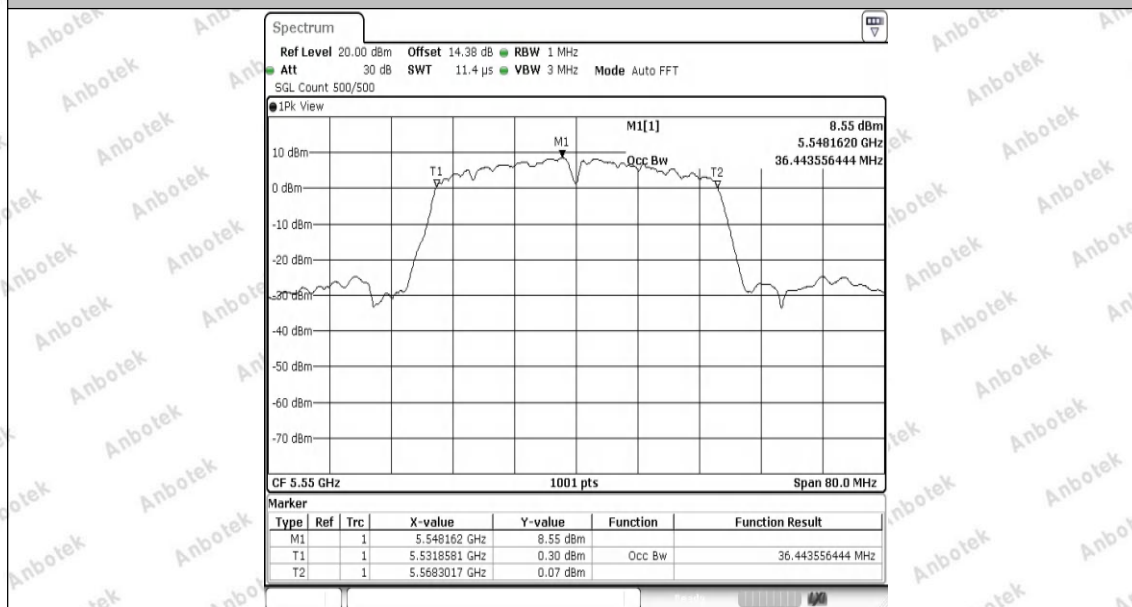


11N40SISO-Ant1-5550



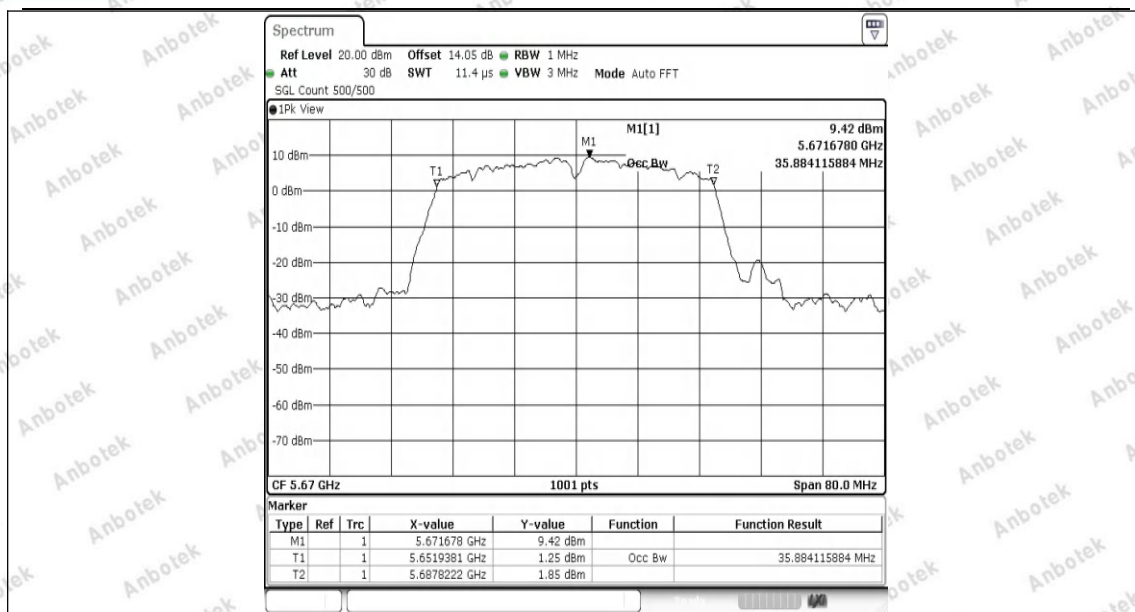



11N40SISO-Ant1-5670

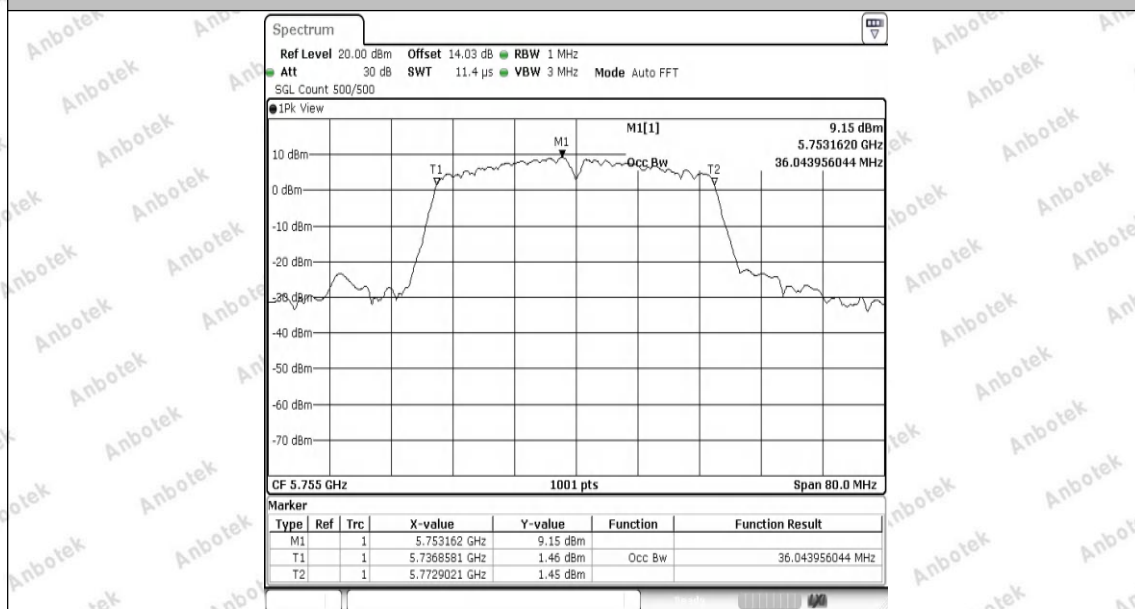


11N40SISO-Ant1-5755



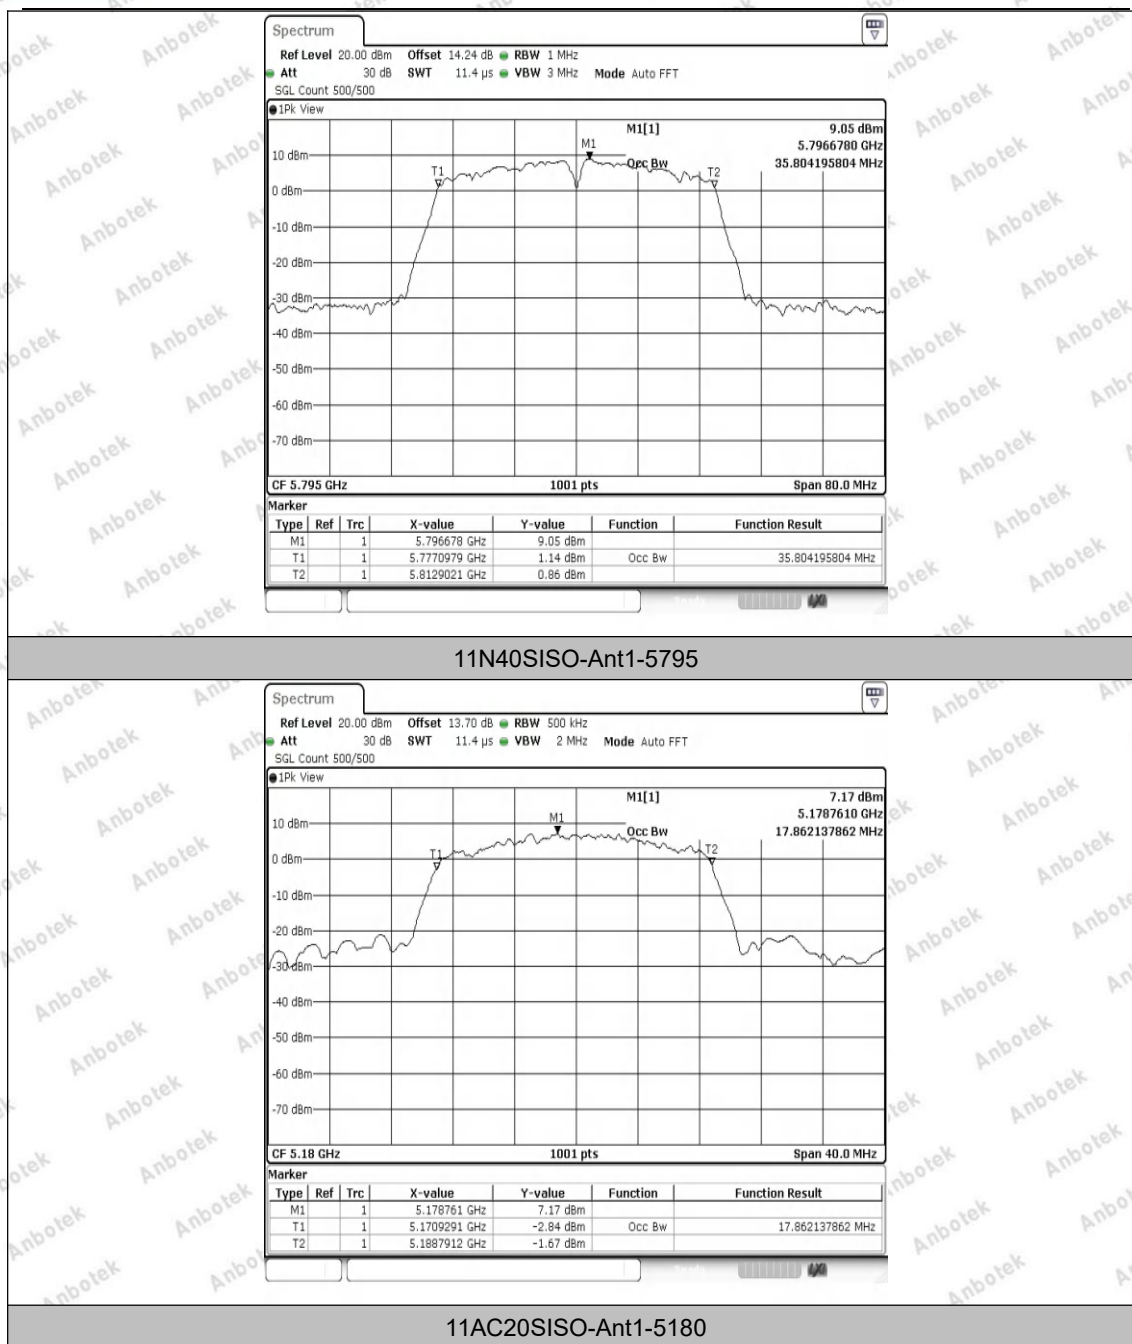

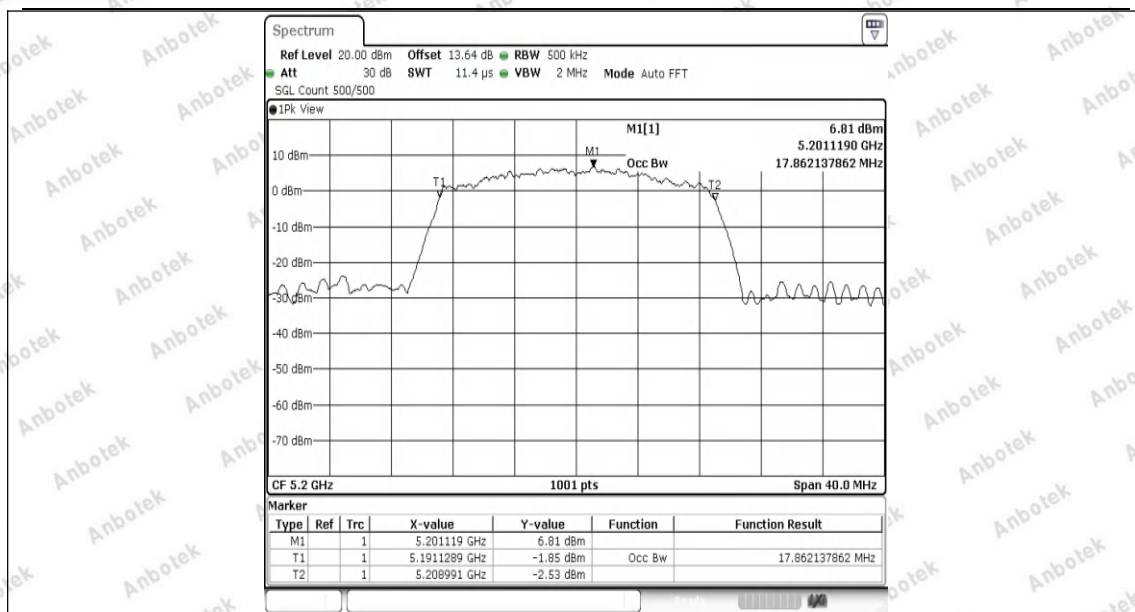


11AC20SISO-Ant1-5200

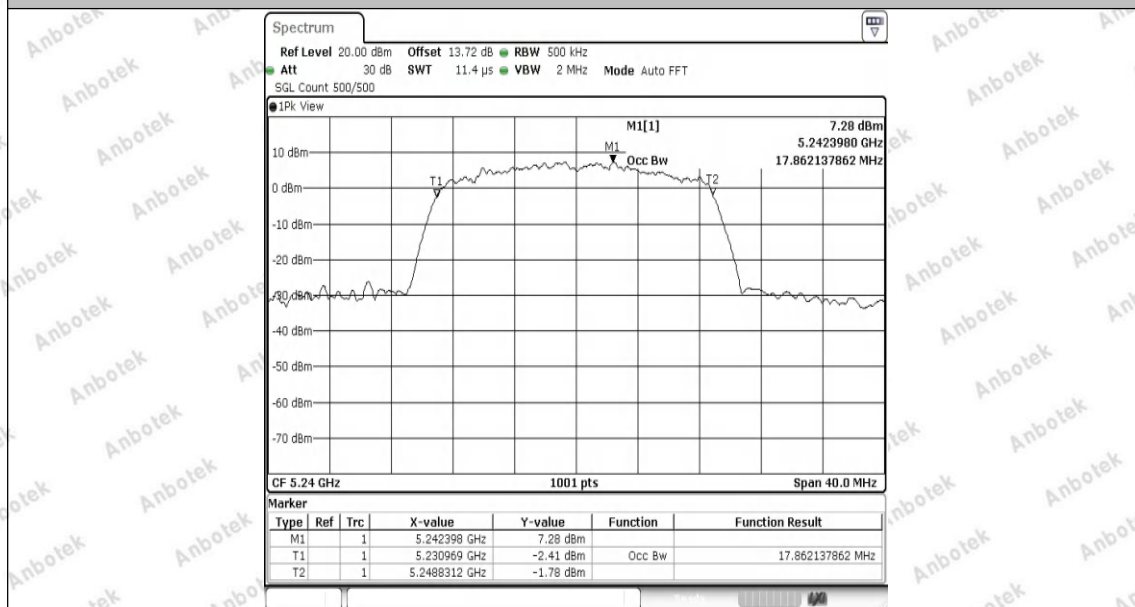


11AC20SISO-Ant1-5240



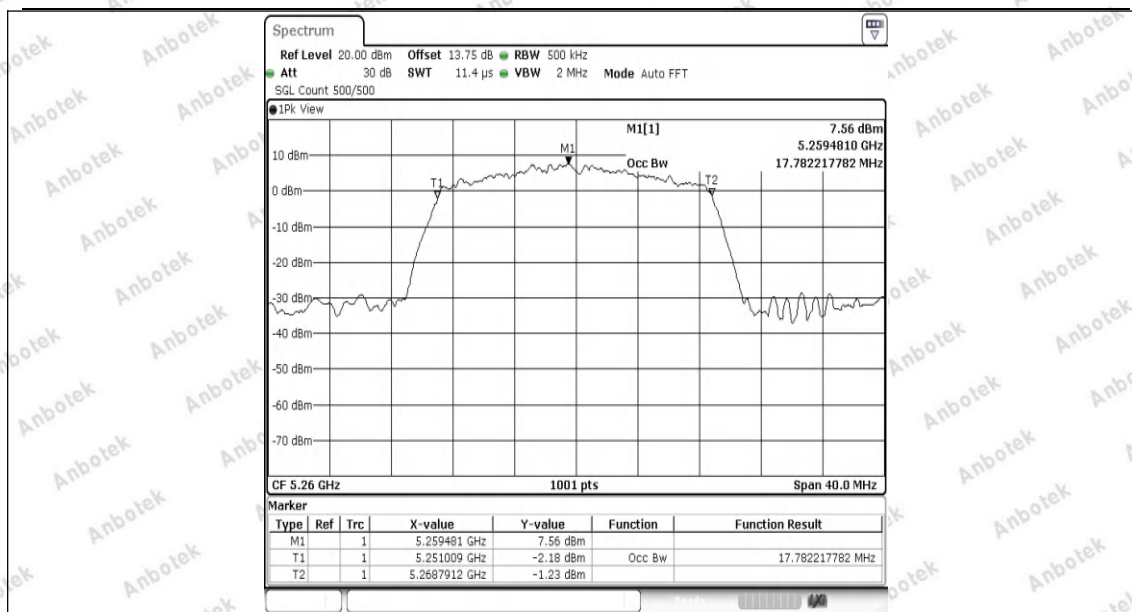


11AC20SISO-Ant1-5260

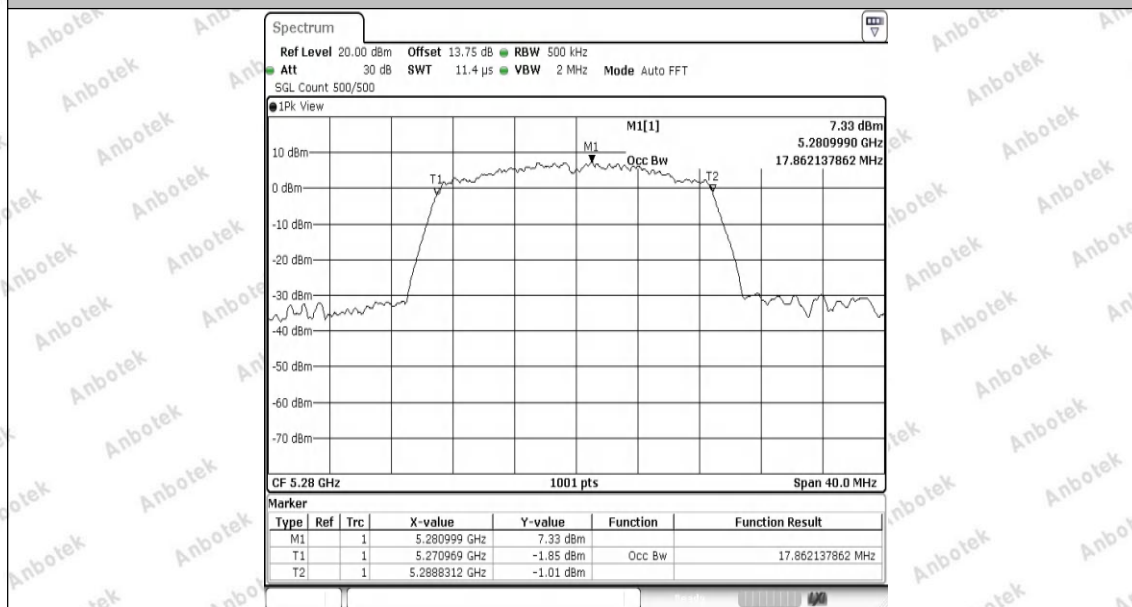


11AC20SISO-Ant1-5280



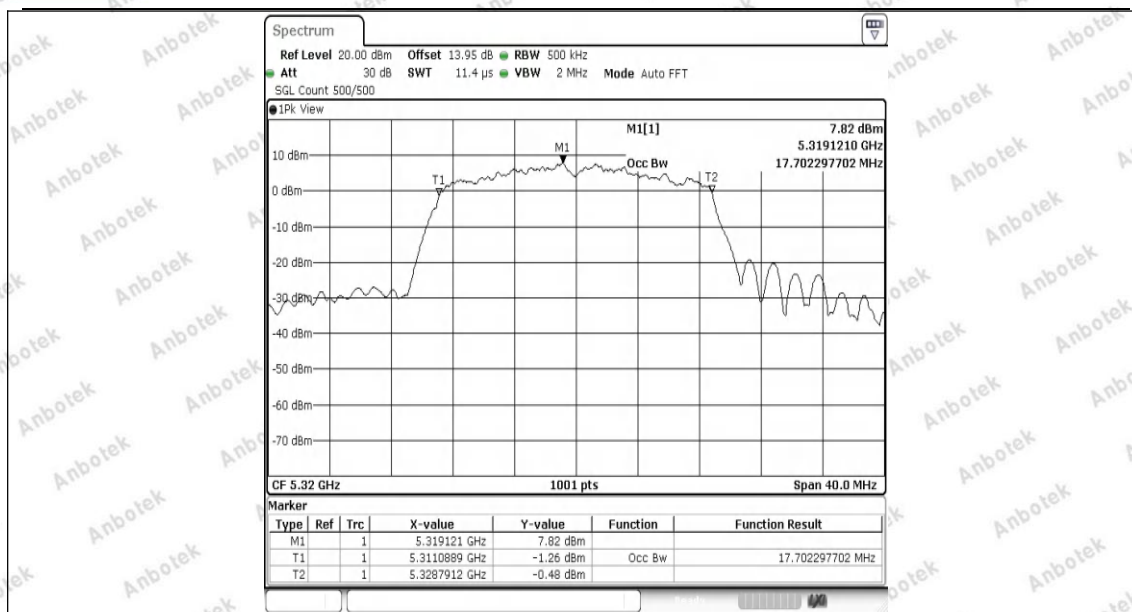


11AC20SISO-Ant1-5320

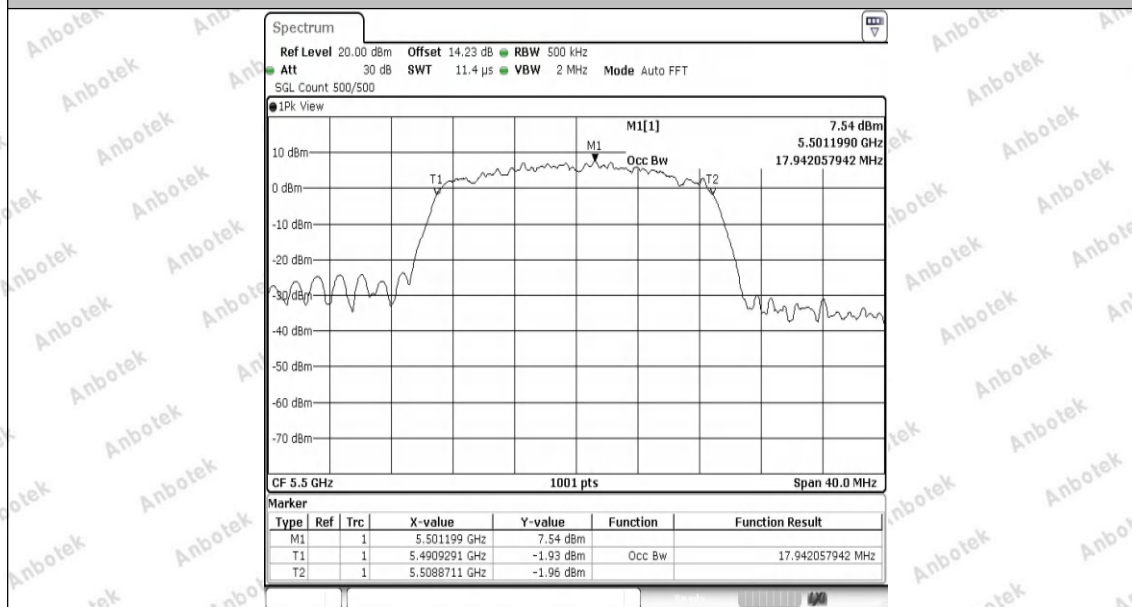


11AC20SISO-Ant1-5500



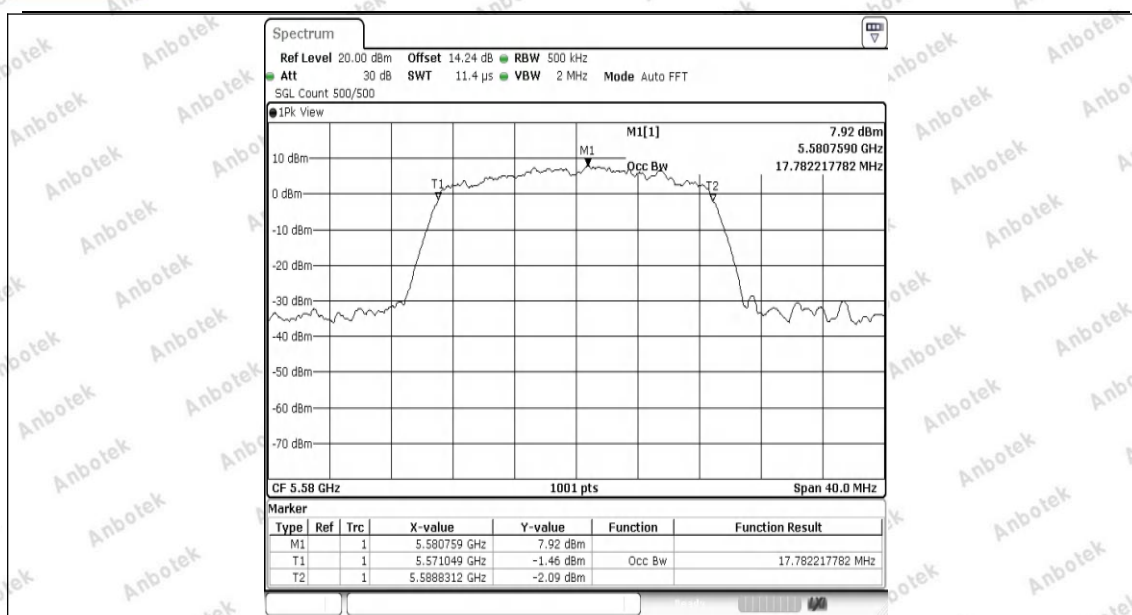



11AC20SISO-Ant1-5580

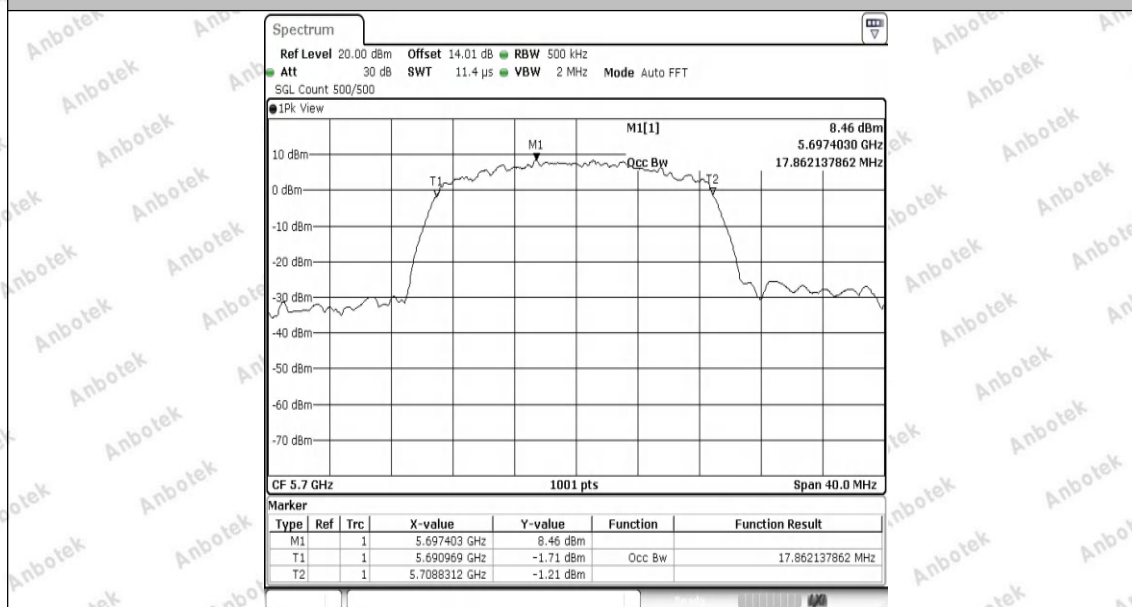


11AC20SISO-Ant1-5700



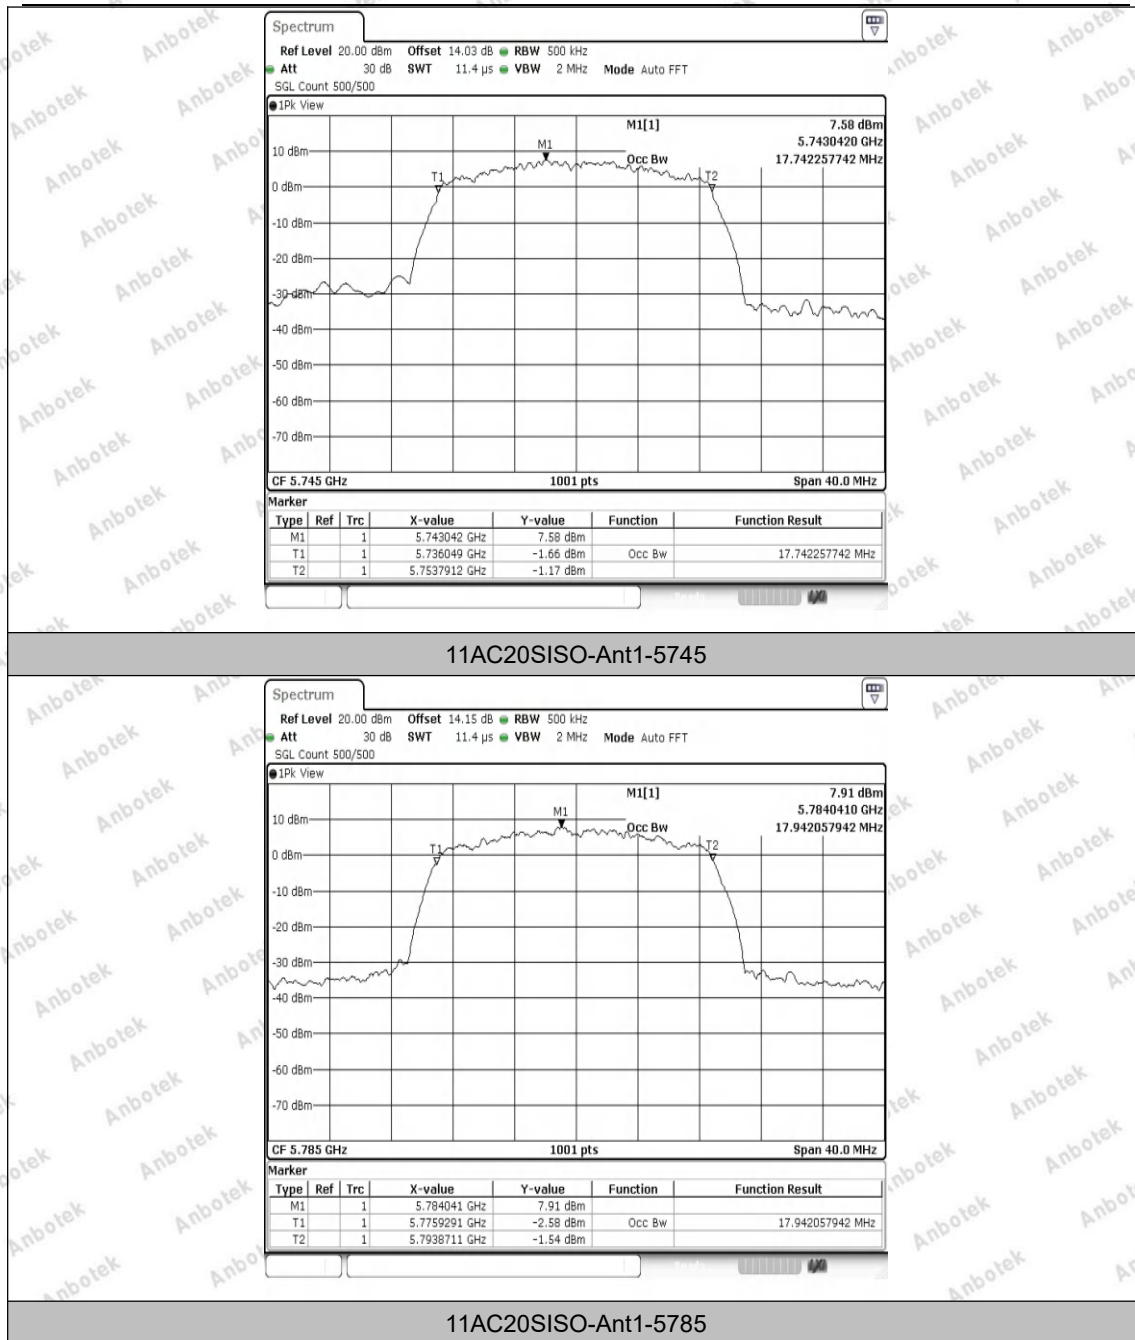

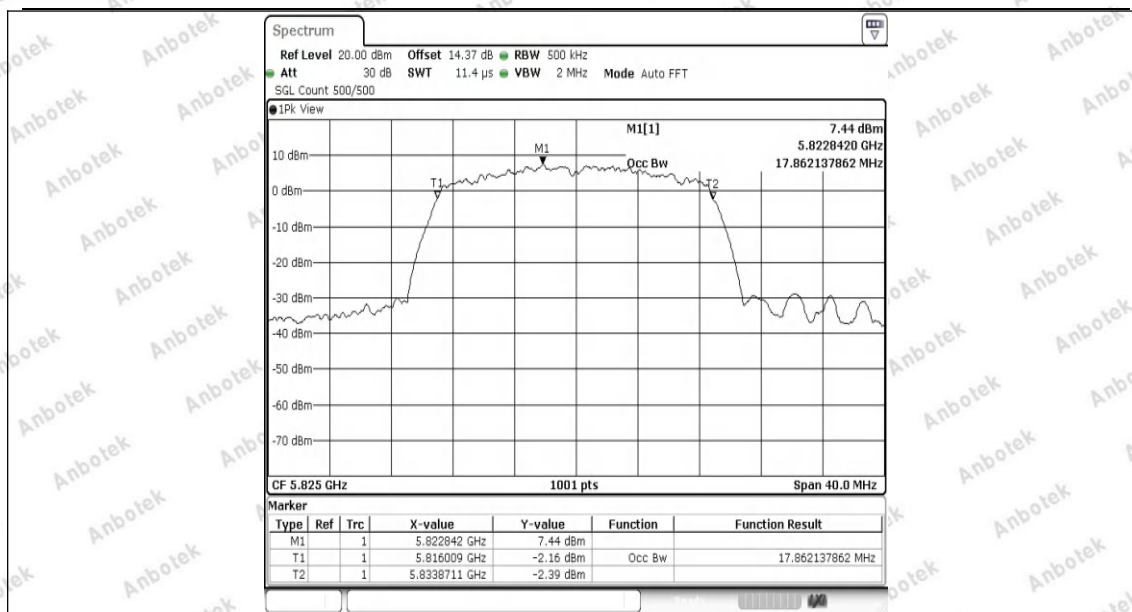


11AC20SISO-Ant1-5825

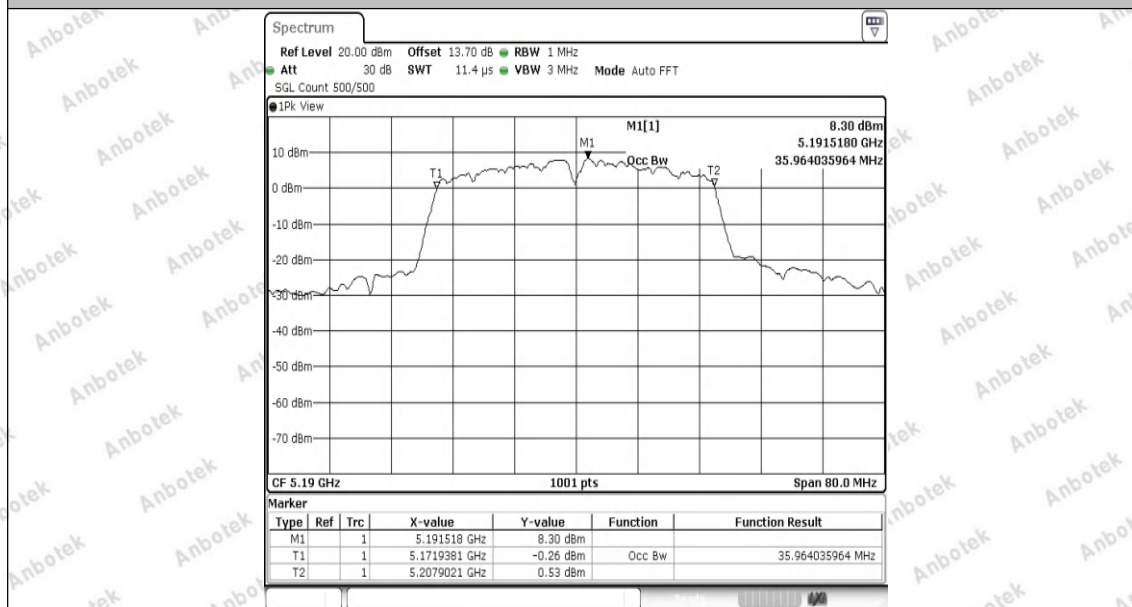


11AC40SISO-Ant1-5190



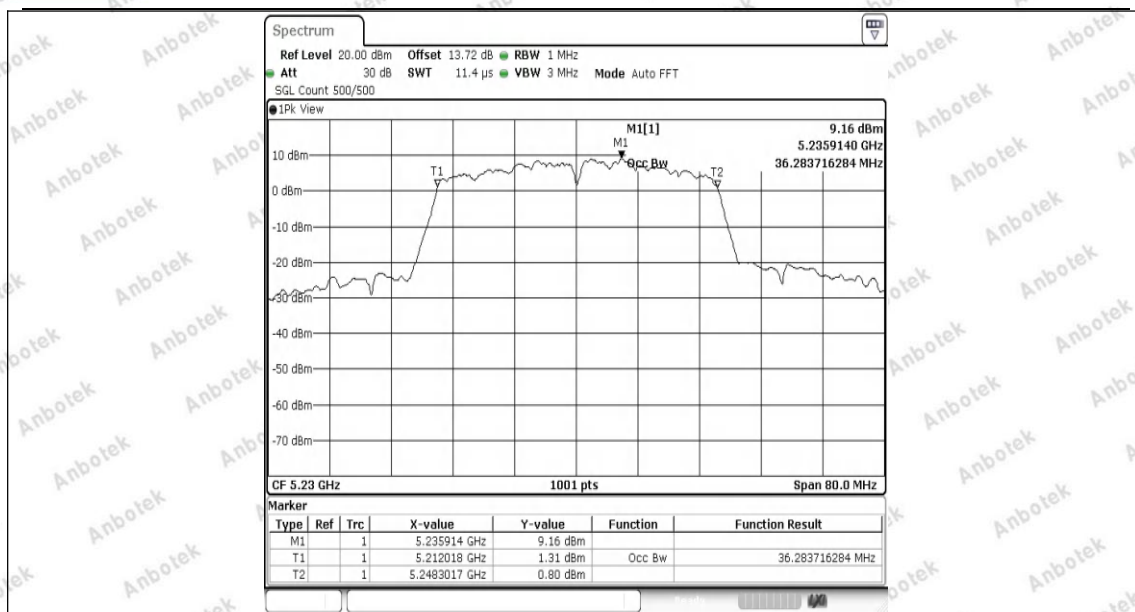


11AC40SISO-Ant1-5230

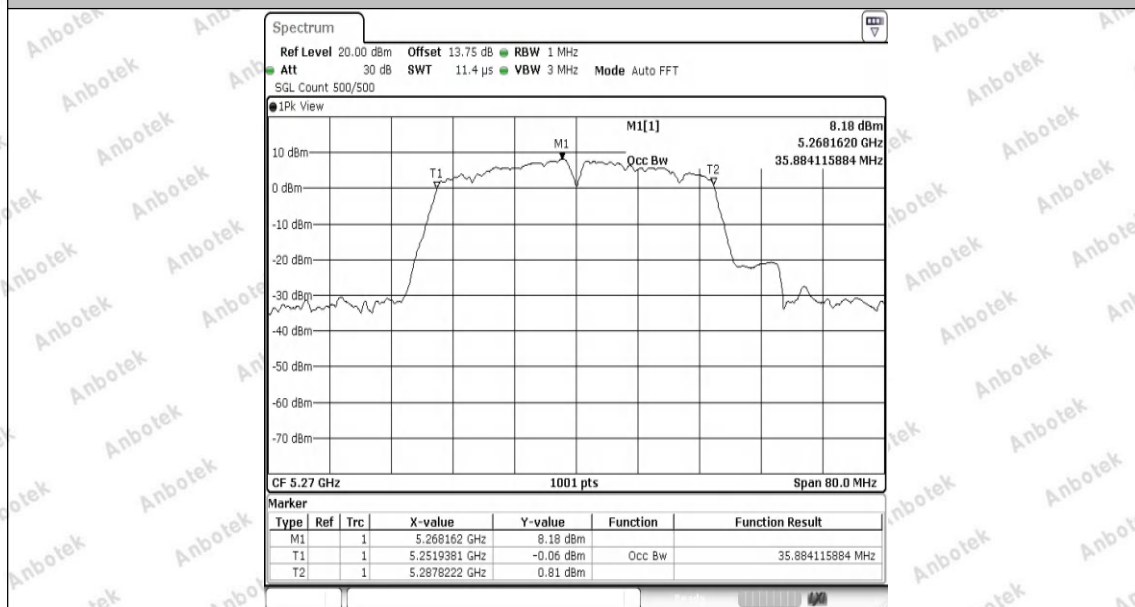


11AC40SISO-Ant1-5270



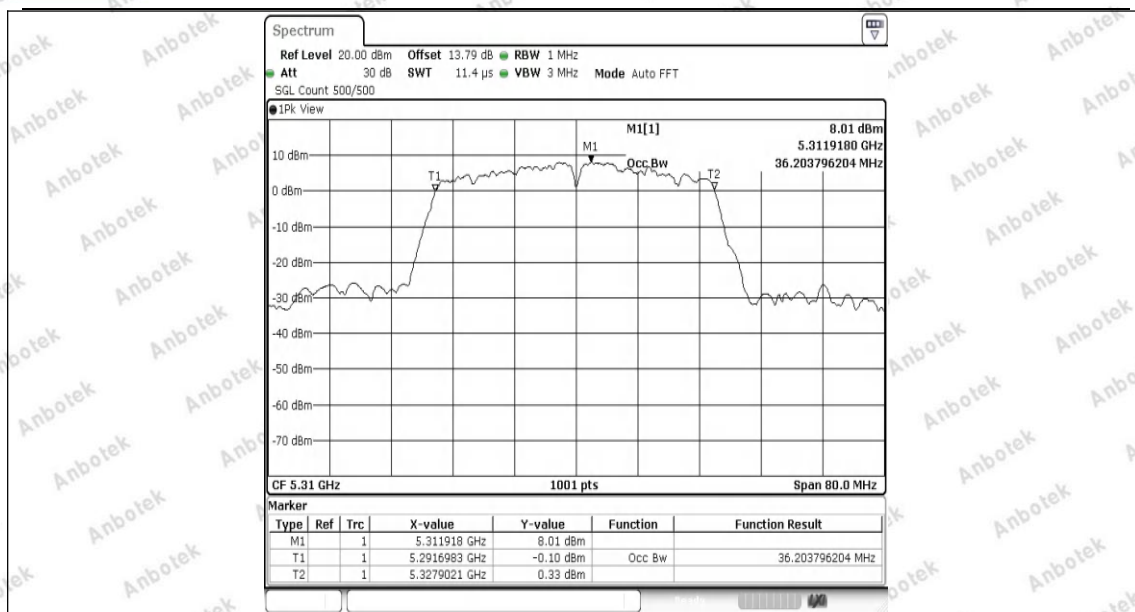


11AC40SISO-Ant1-5310

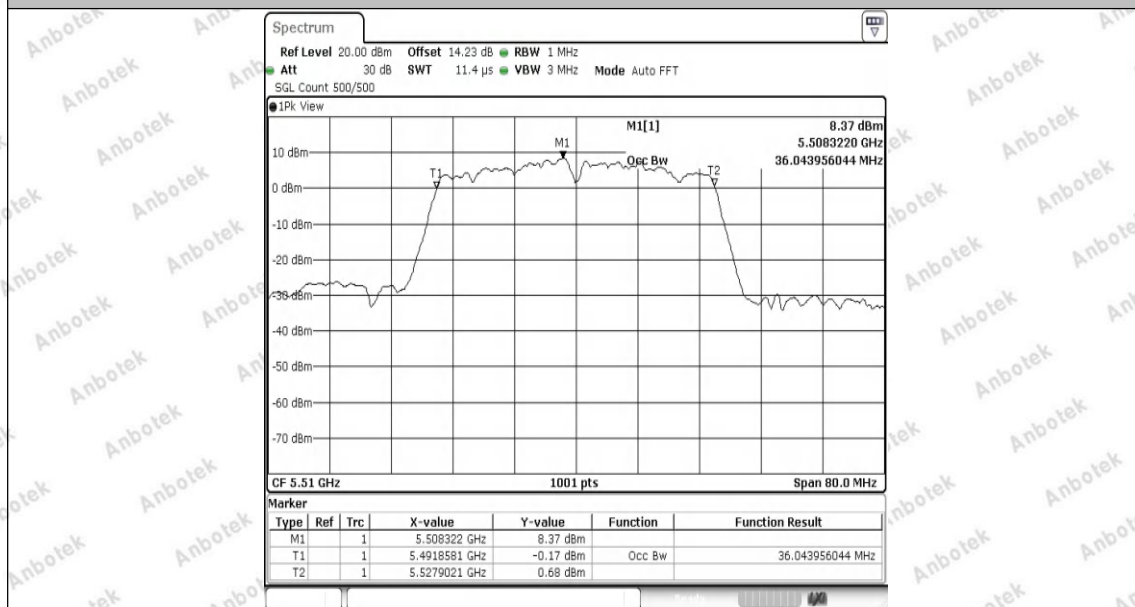


11AC40SISO-Ant1-5510



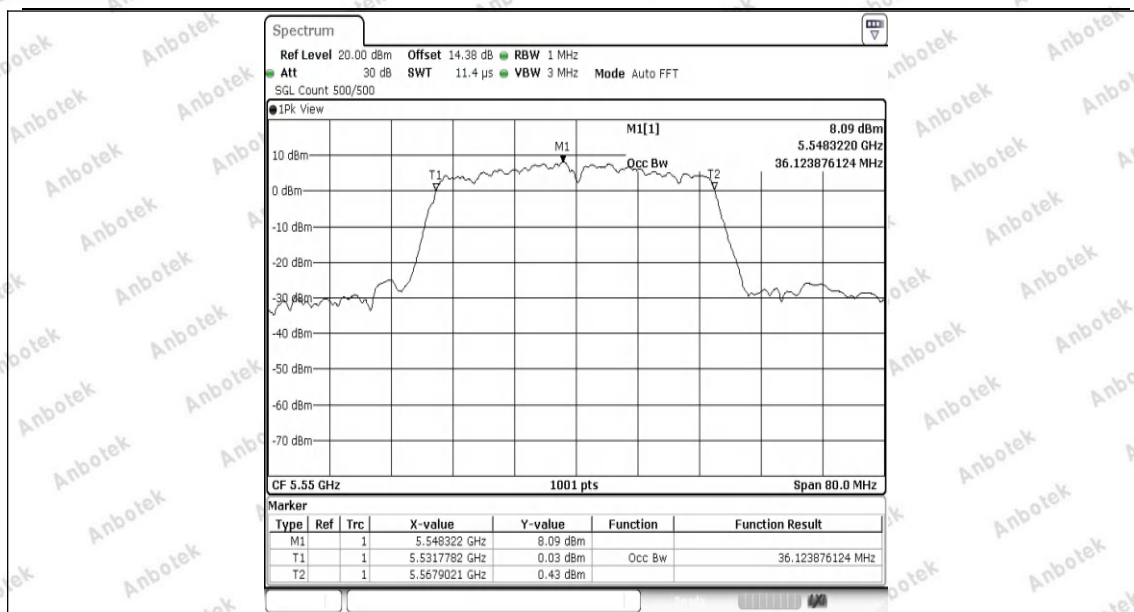


11AC40SISO-Ant1-5550

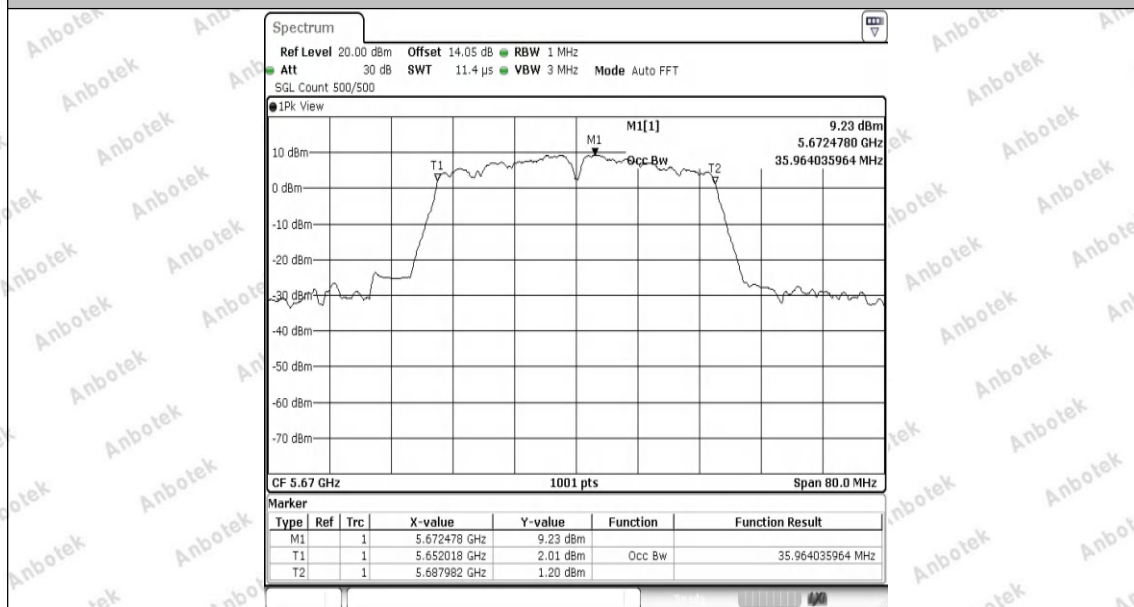


11AC40SISO-Ant1-5670



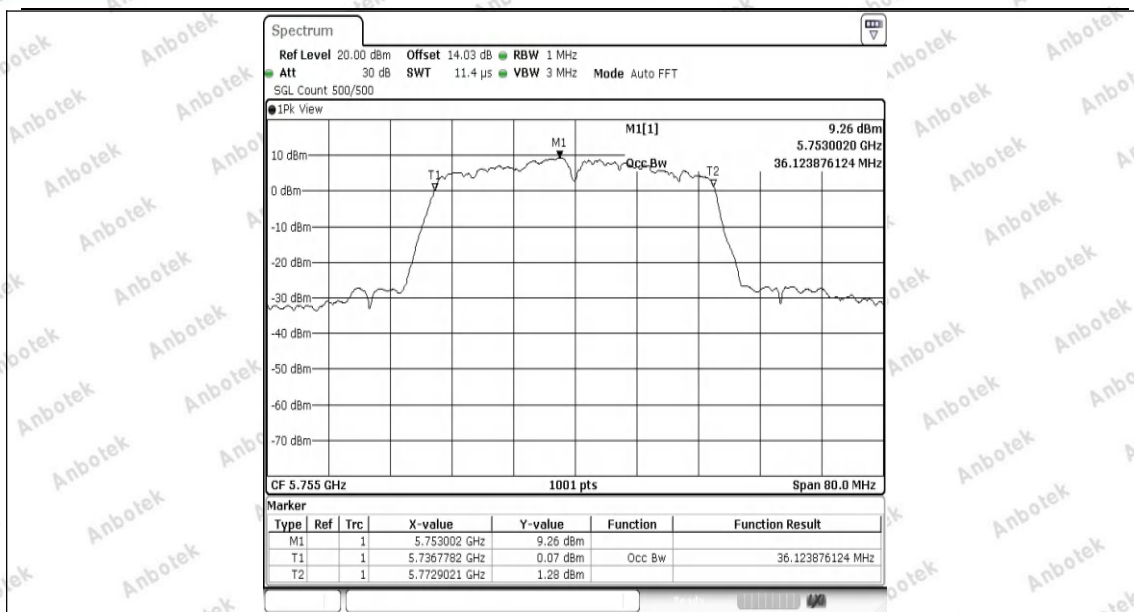


11AC40SISO-Ant1-5755

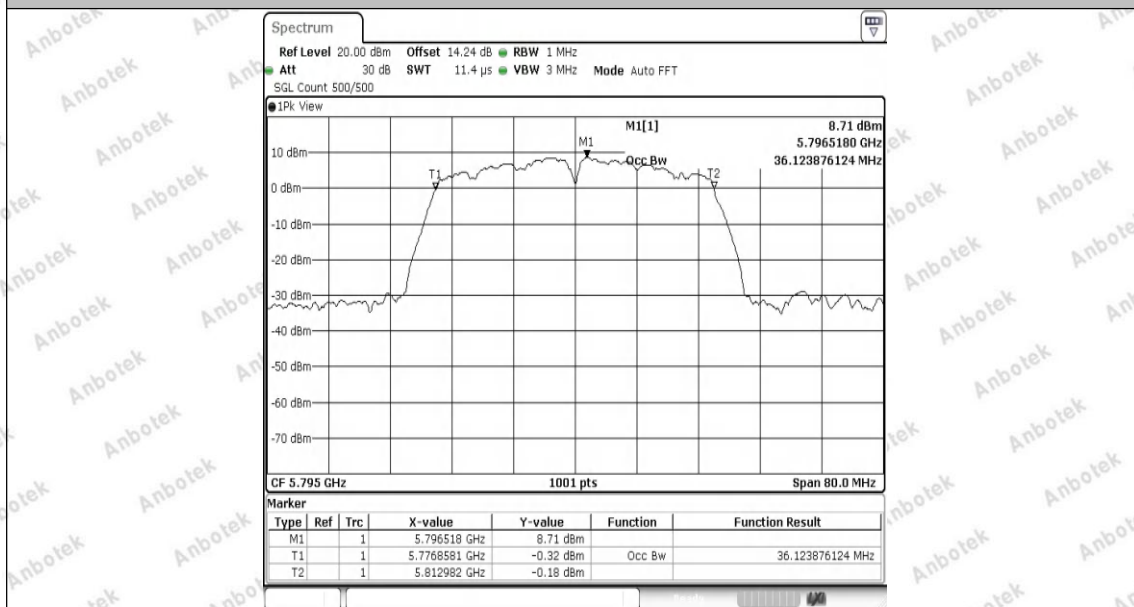


11AC40SISO-Ant1-5795



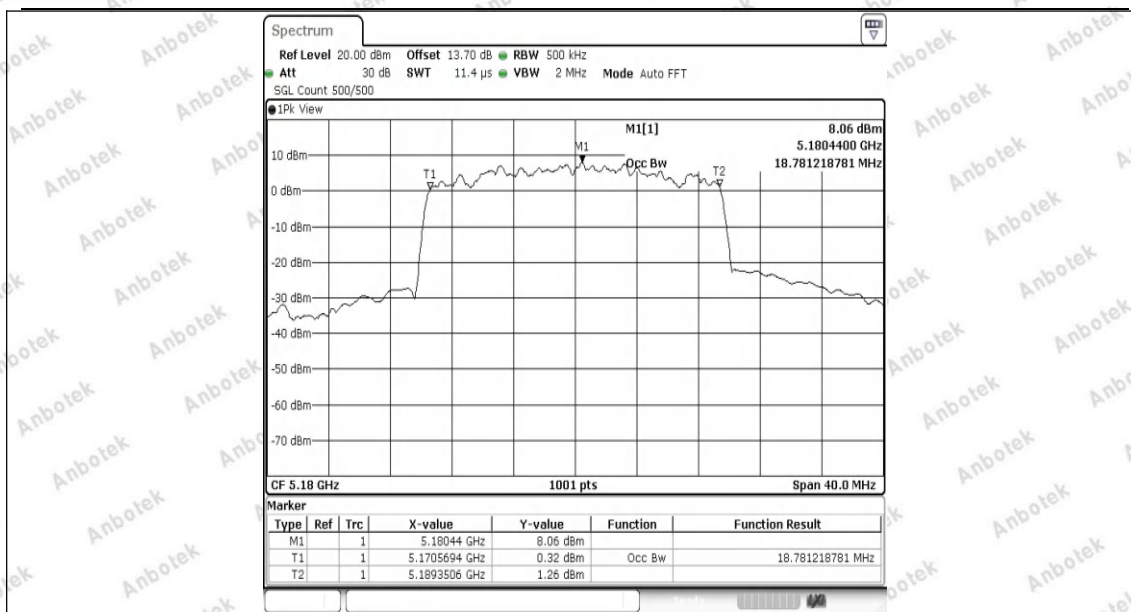


11AX20SISO-Ant1-5180

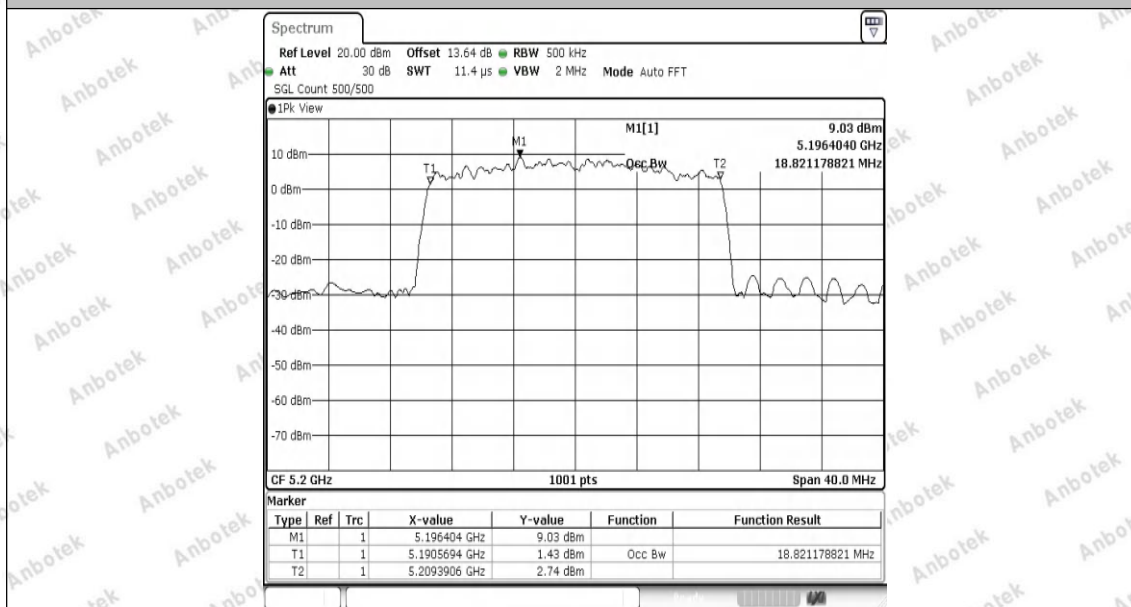


11AX20SISO-Ant1-5200



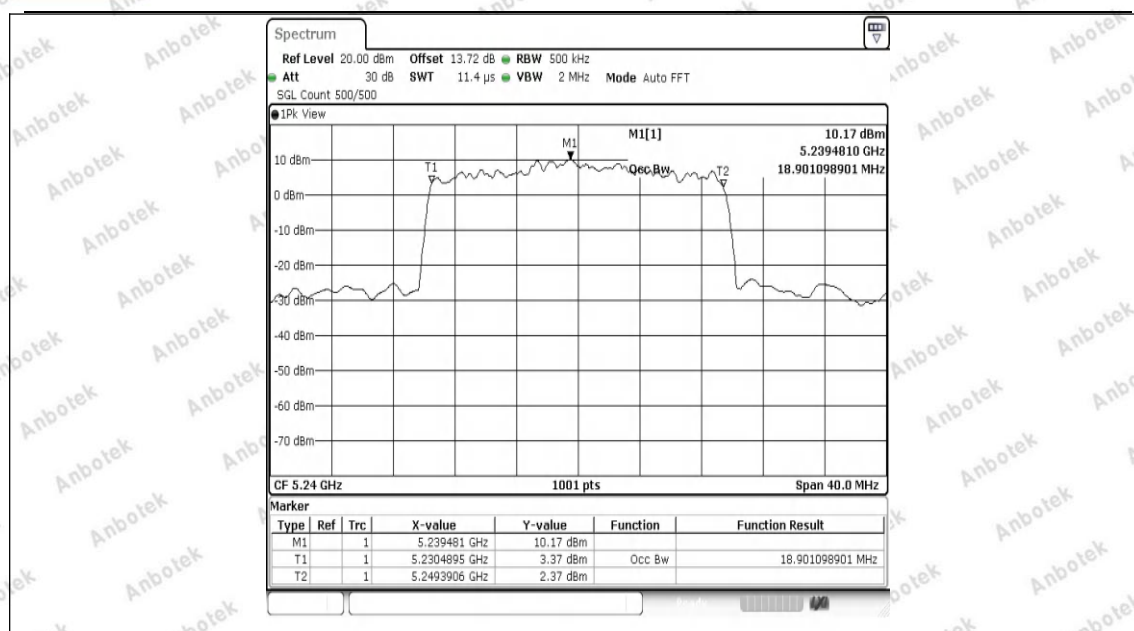


11AX20SISO-Ant1-5240

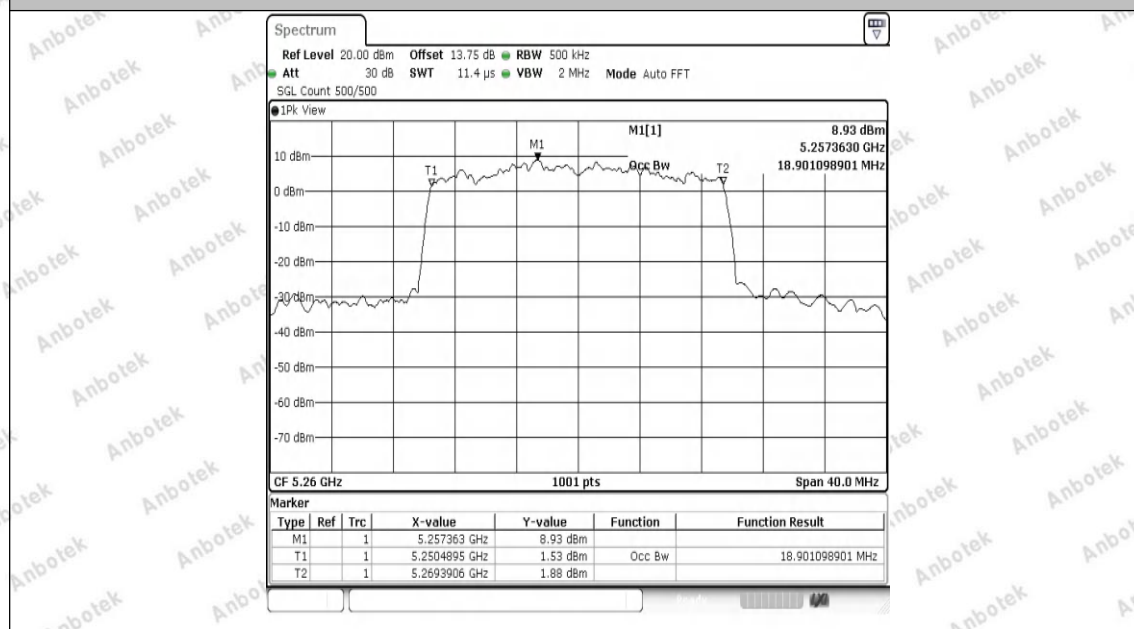


11AX20SISO-Ant1-5260



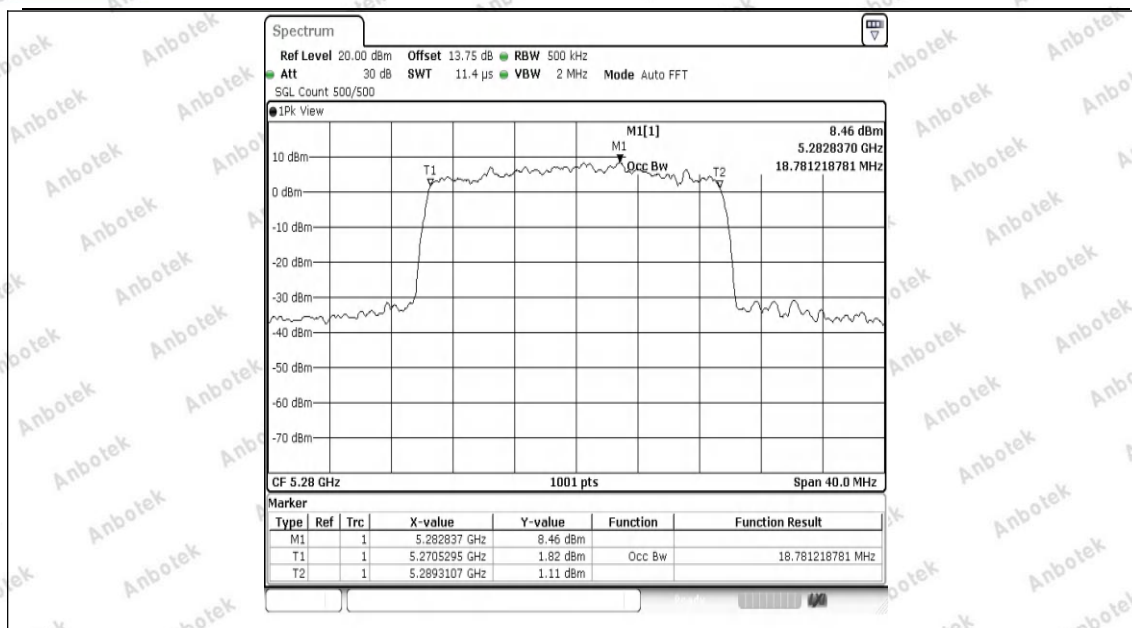



11AX20SISO-Ant1-5280

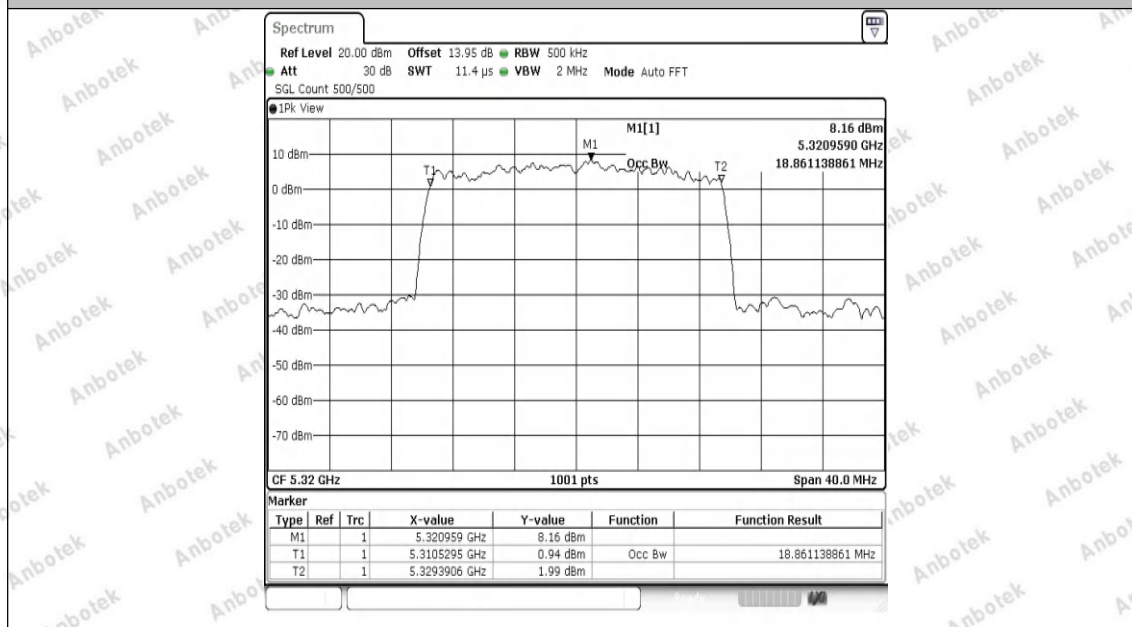


11AX20SISO-Ant1-5320




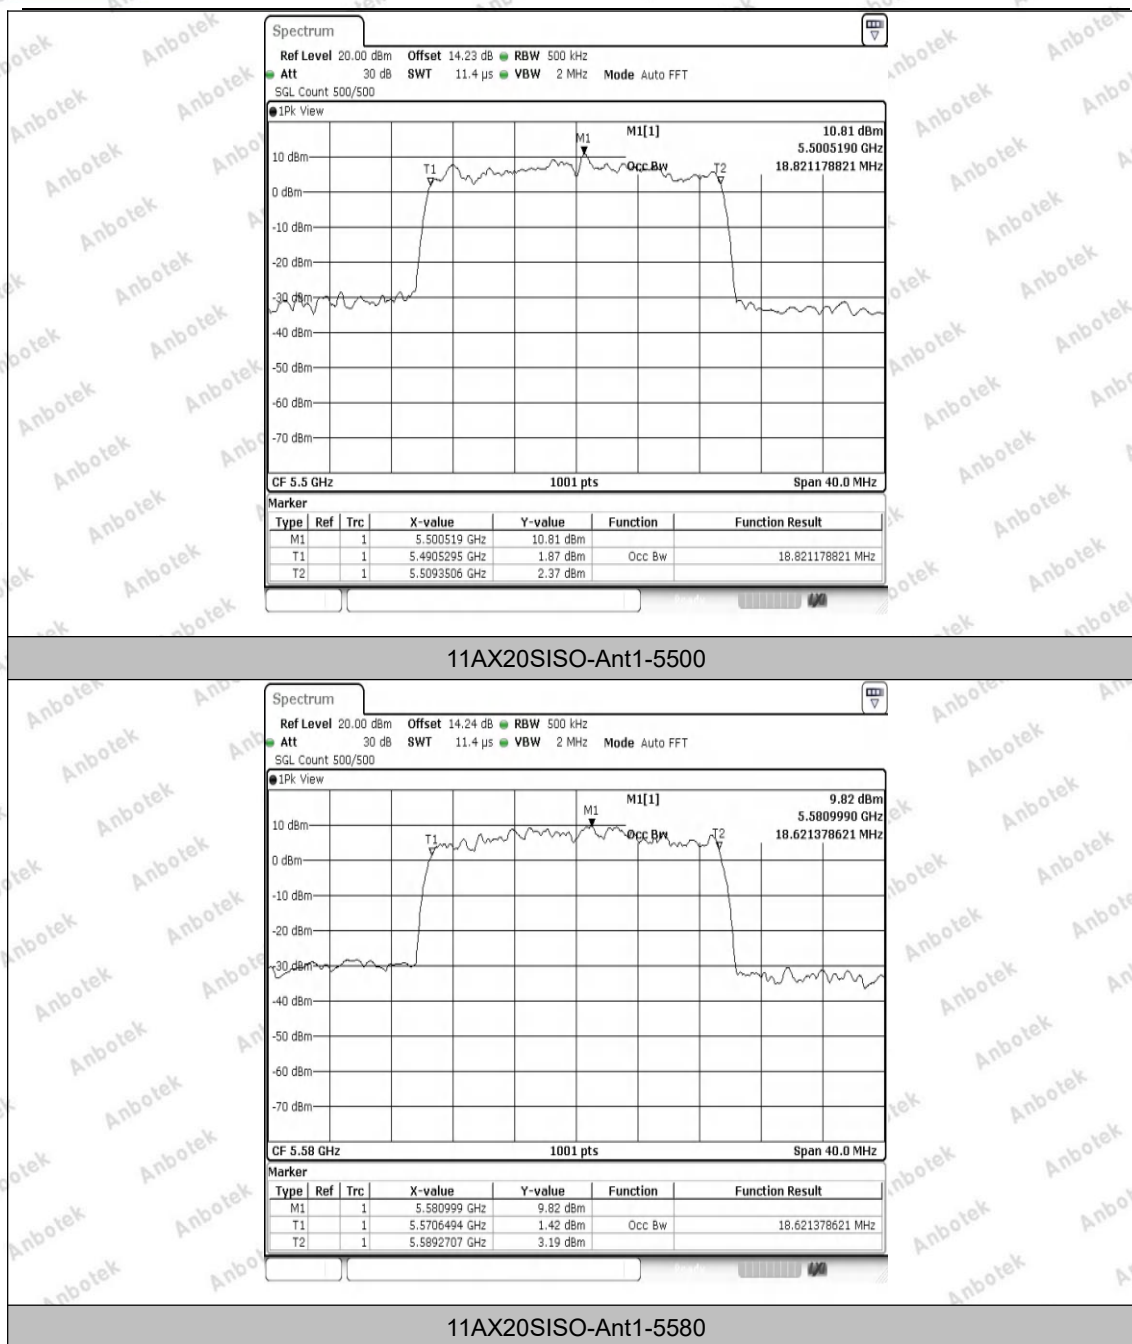

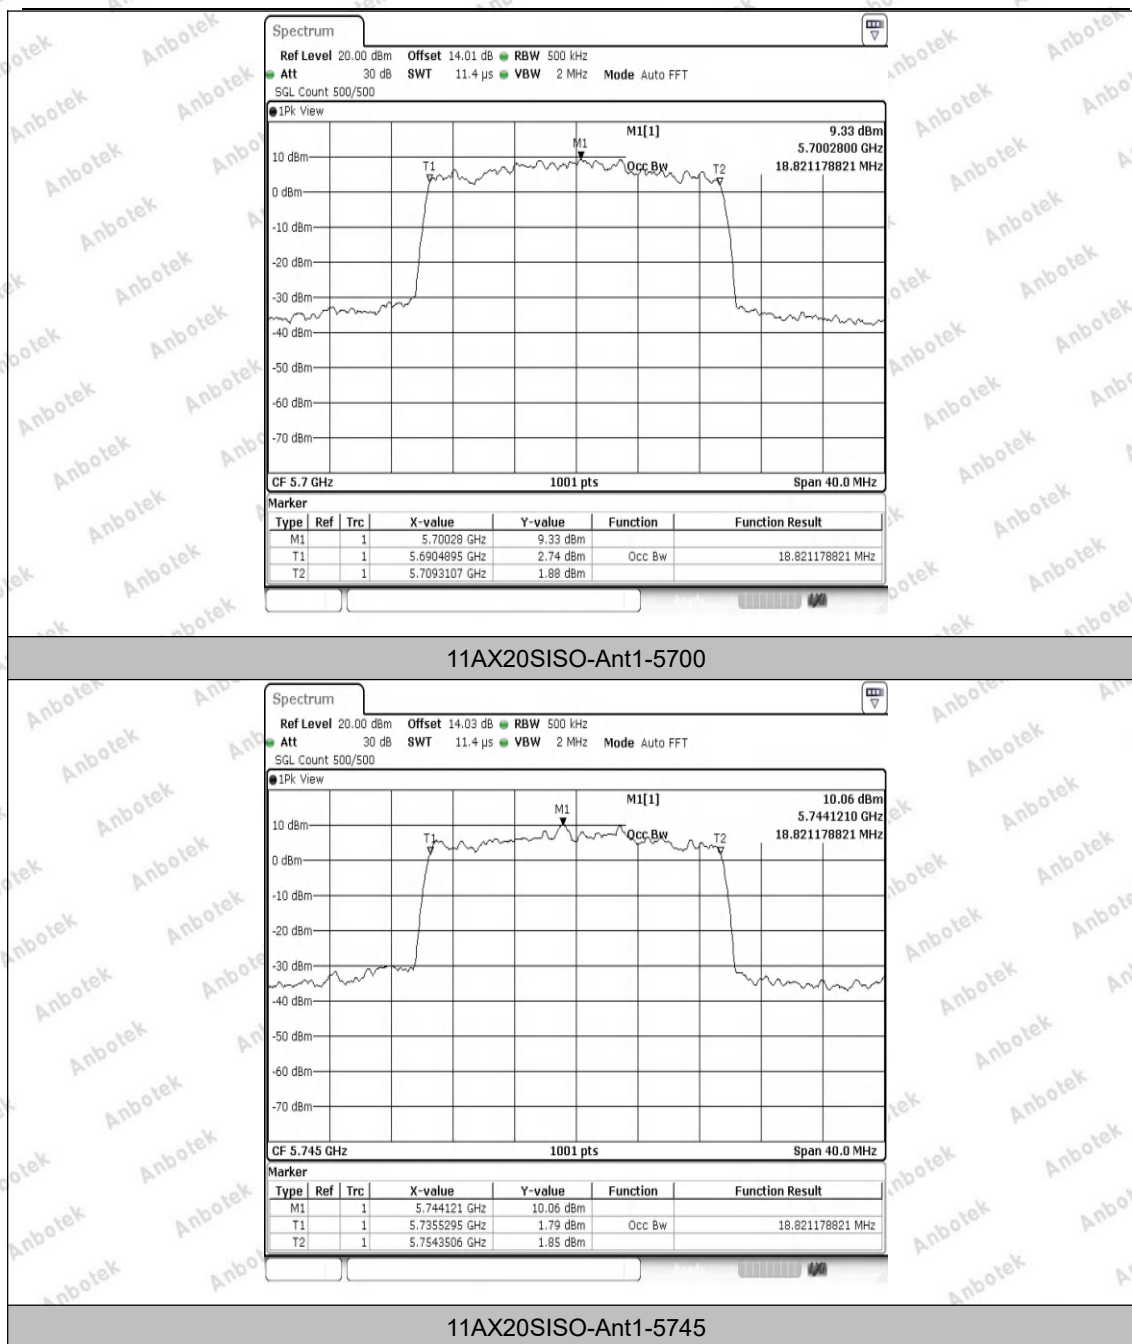

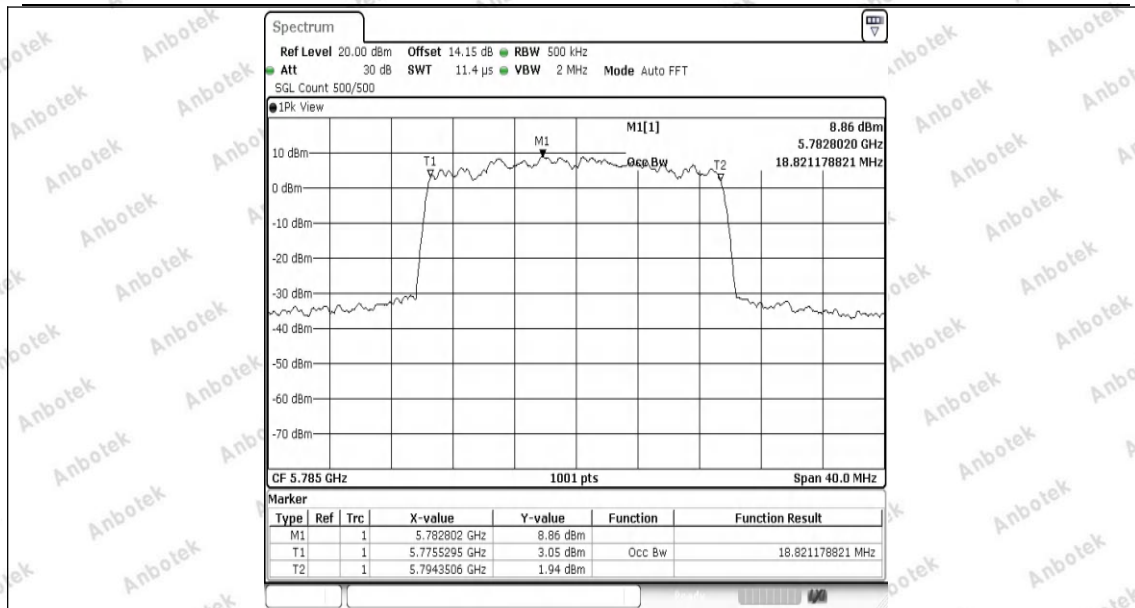


11AX20SISO-Ant1-5785

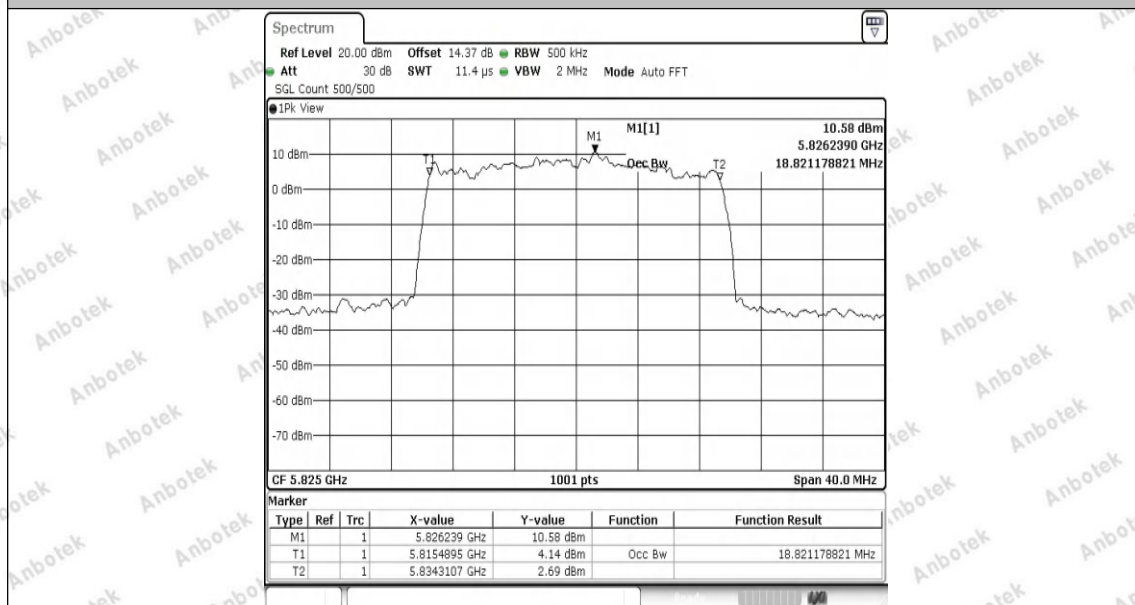


11AX20SISO-Ant1-5825



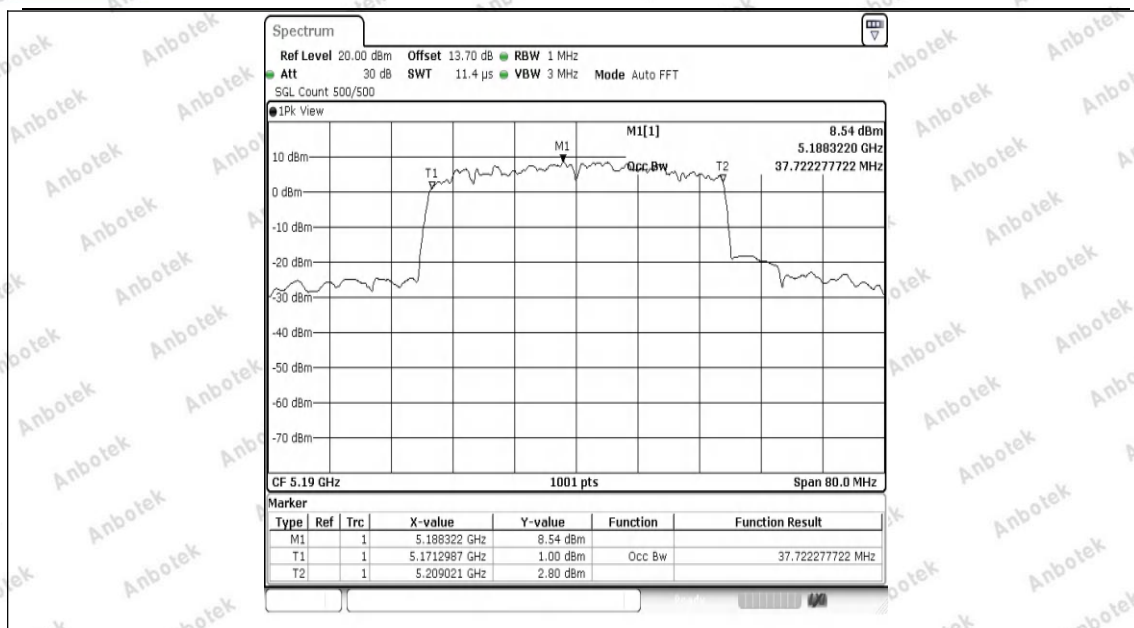


11AX40SISO-Ant1-5190

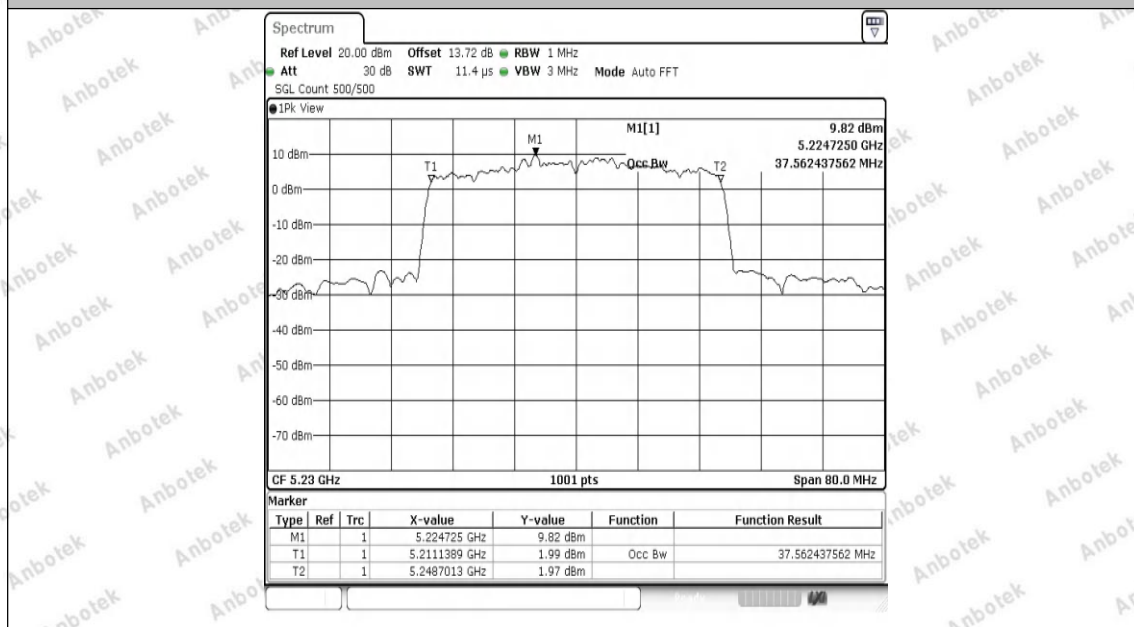


11AX40SISO-Ant1-5230



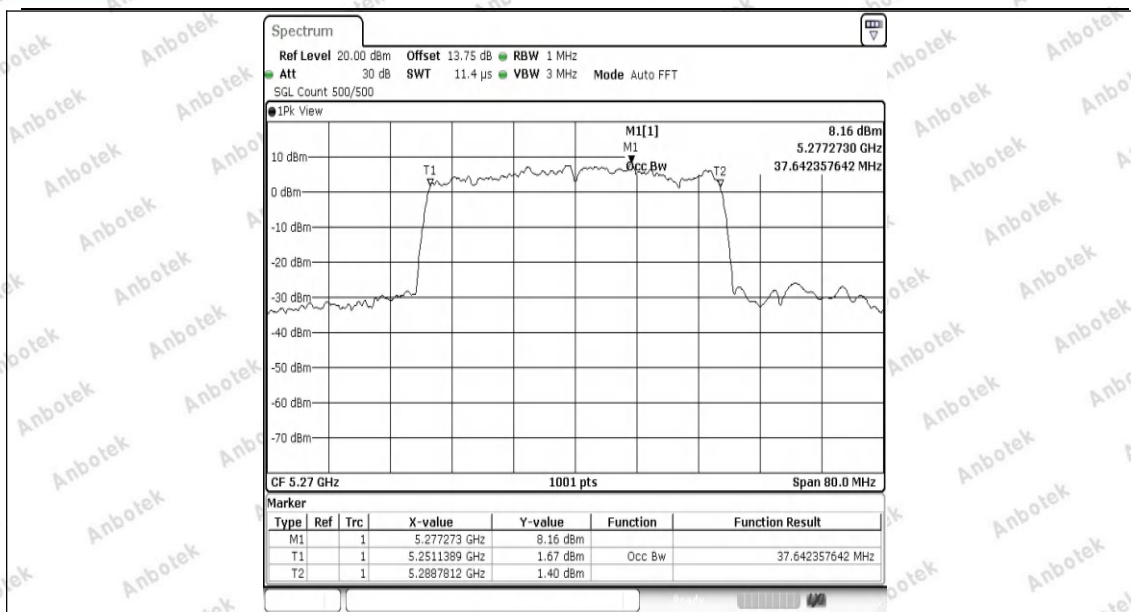


11AX40SISO-Ant1-5270

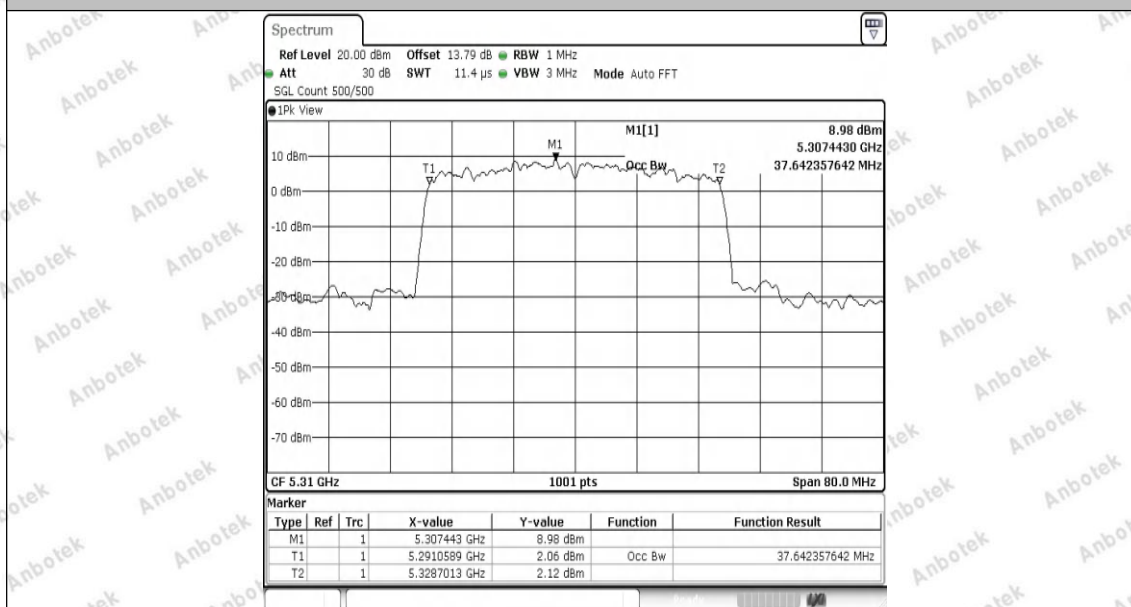


11AX40SISO-Ant1-5310



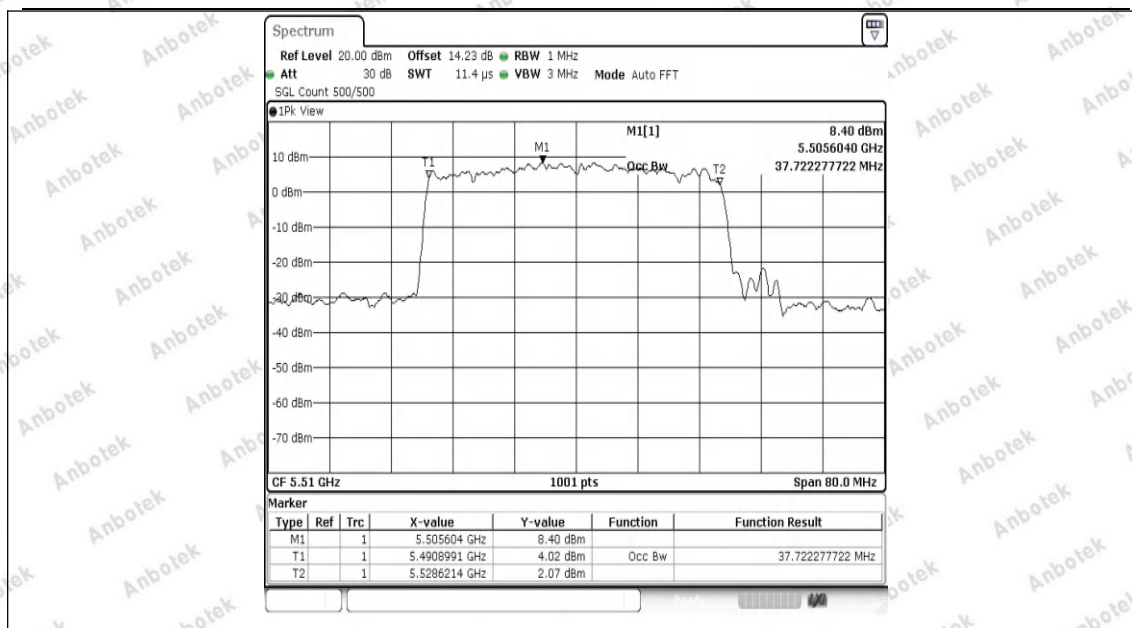


11AX40SISO-Ant1-5510

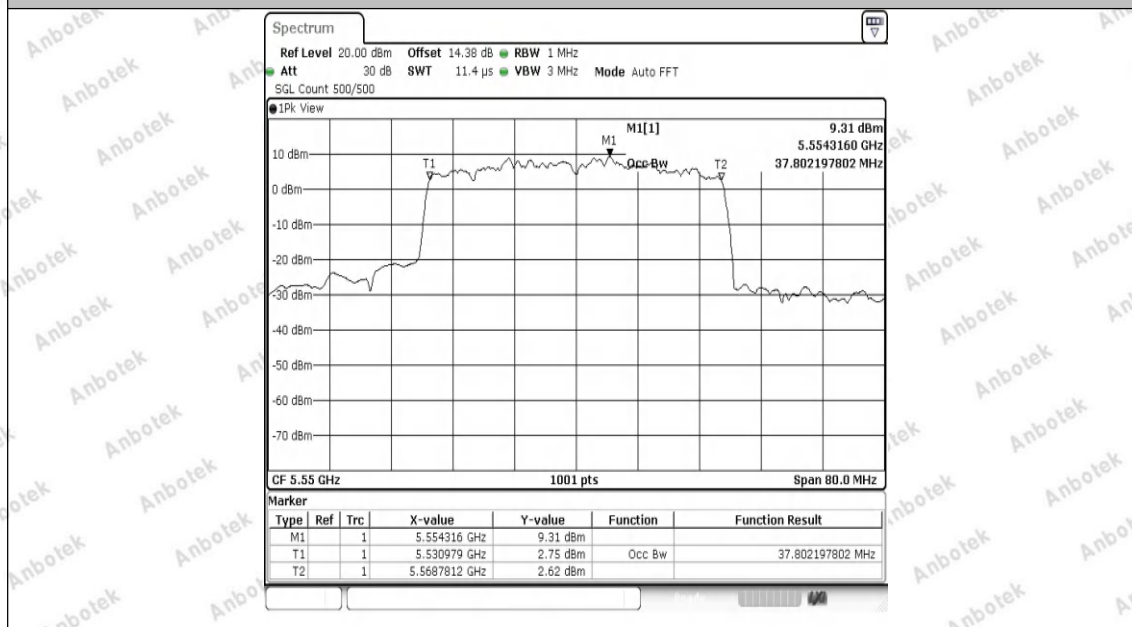


11AX40SISO-Ant1-5550



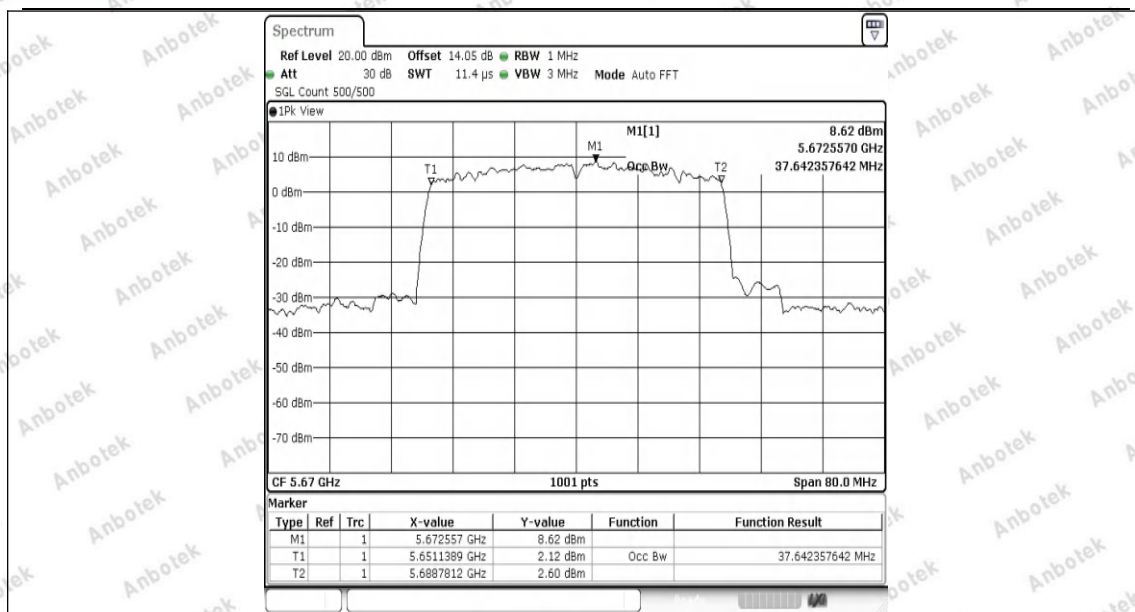

11AX40SISO-Ant1-5670

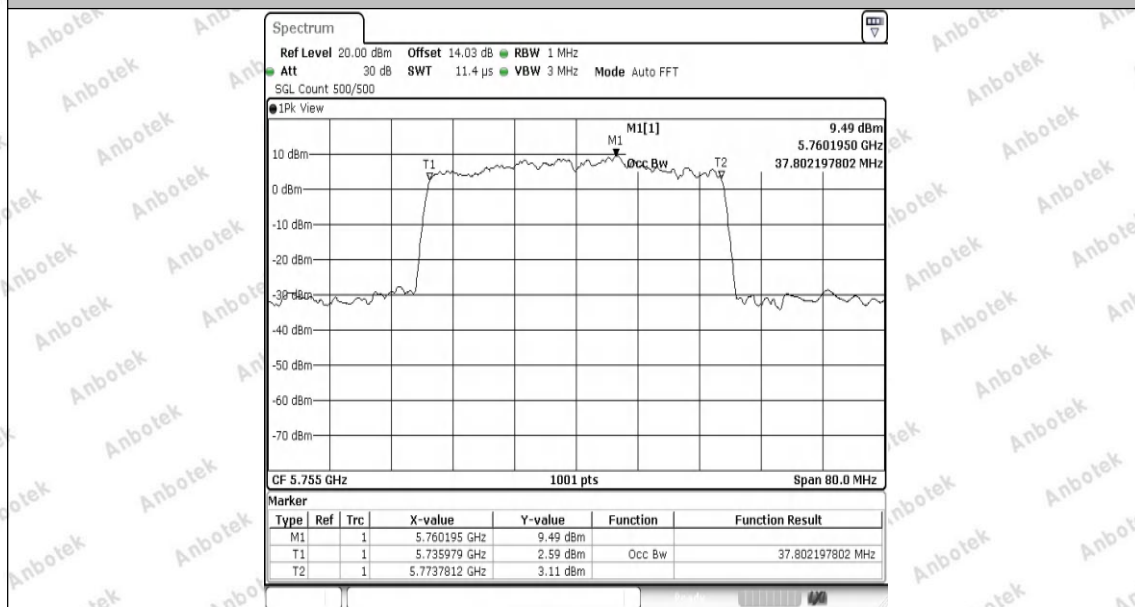

11AX40SISO-Ant1-5755

