




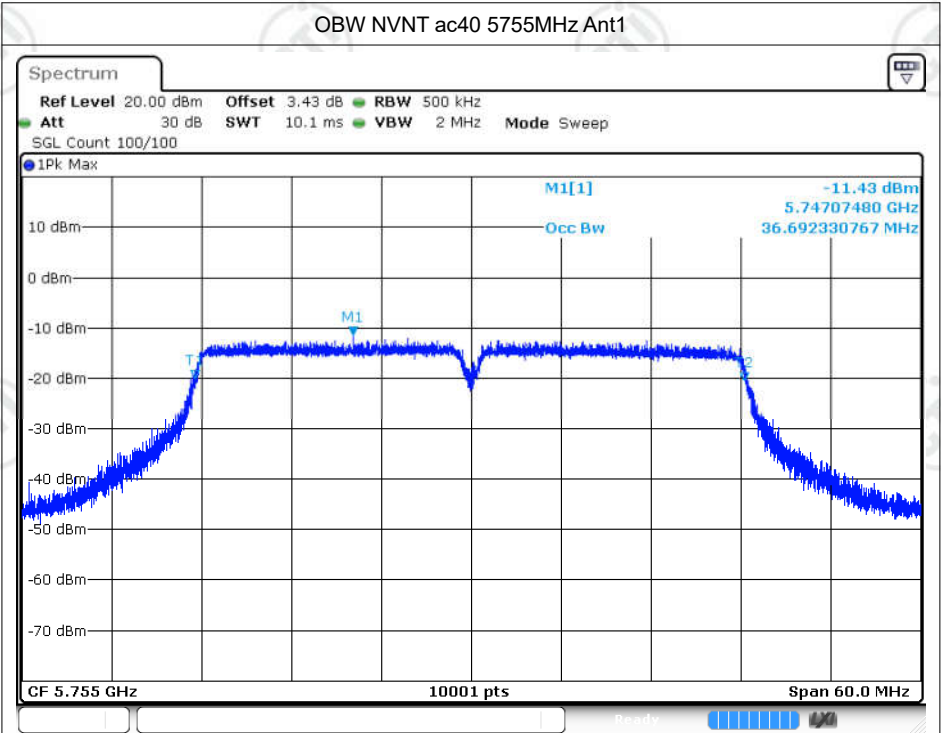


Date: 8.DEC.2024 14:10:11

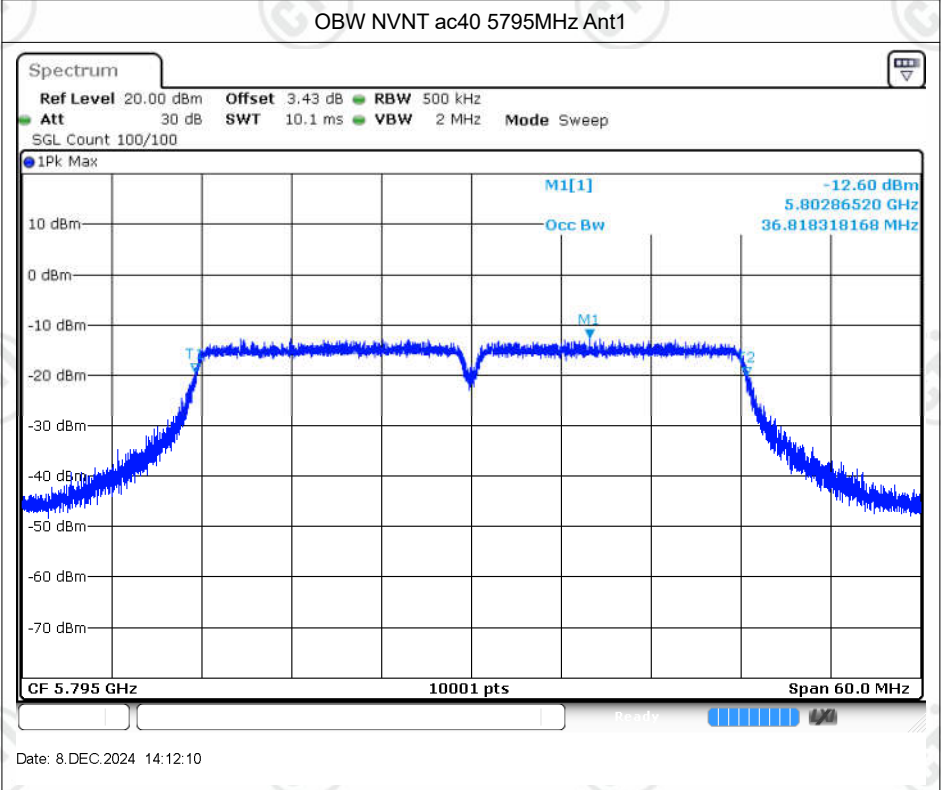


Date: 8.DEC.2024 14:12:10

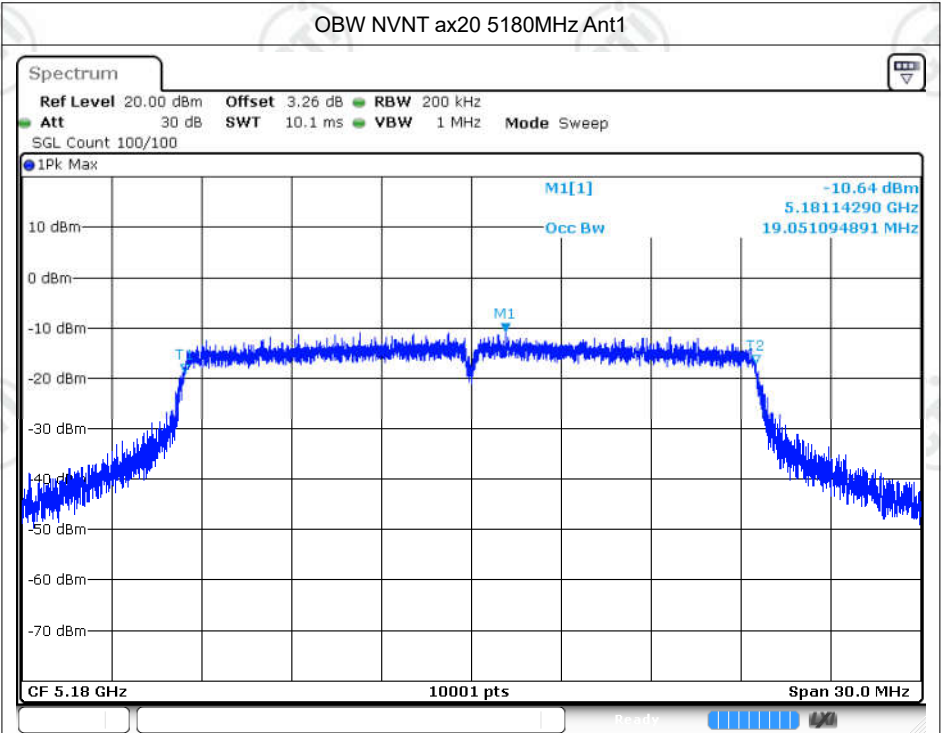


Date: 8.DEC.2024 14:14:31

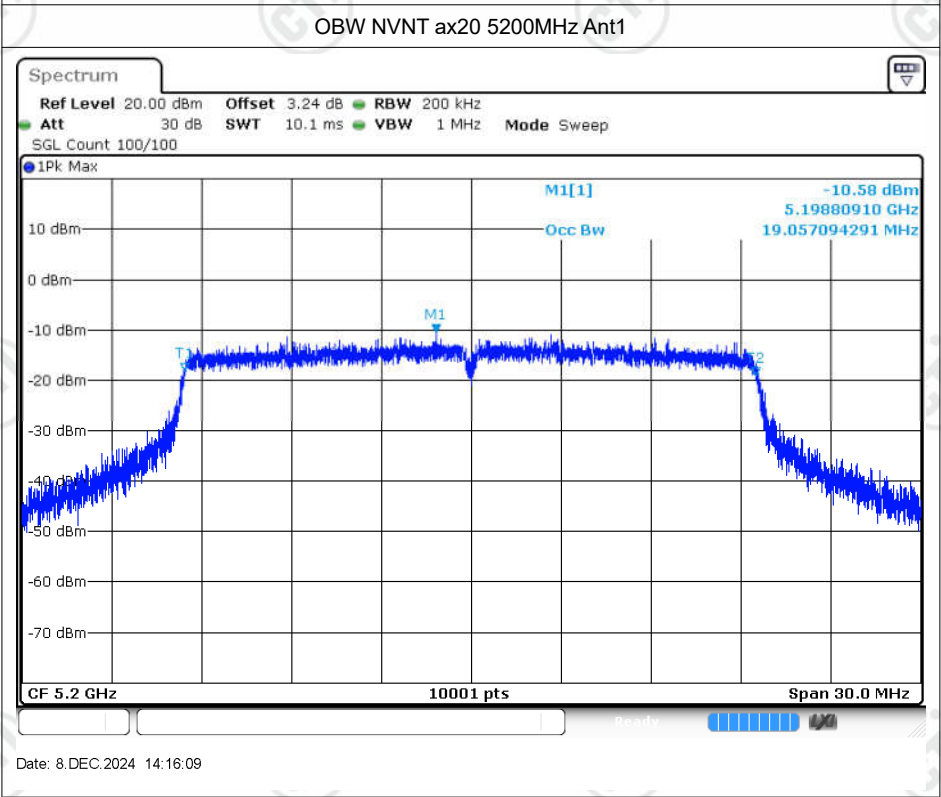

Date: 8.DEC.2024 14:16:09

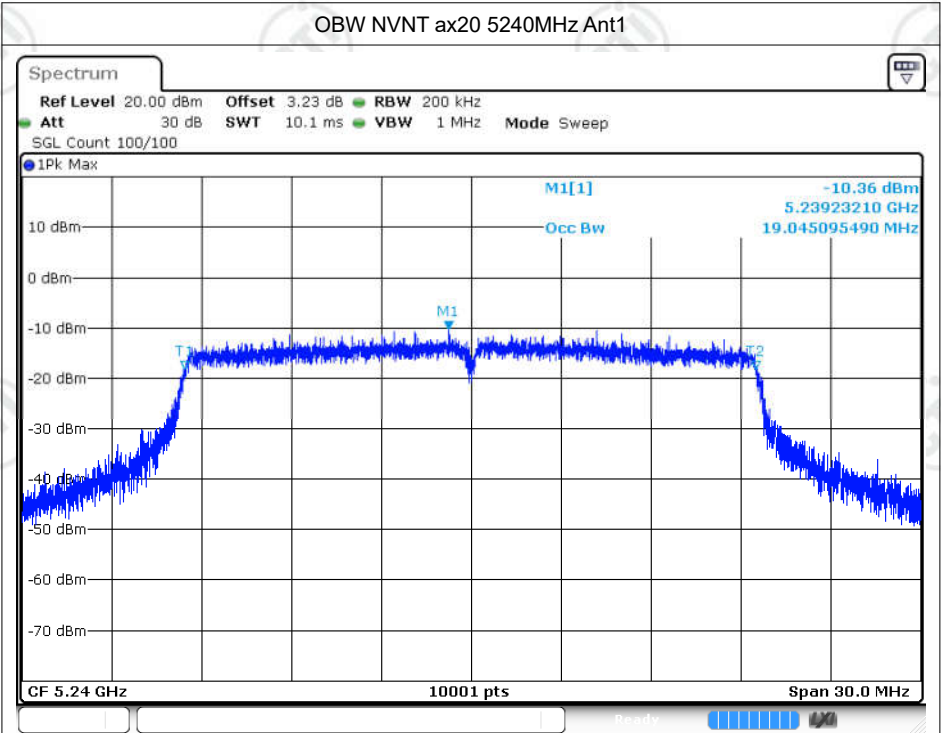


Date: 8.DEC.2024 14:18:04

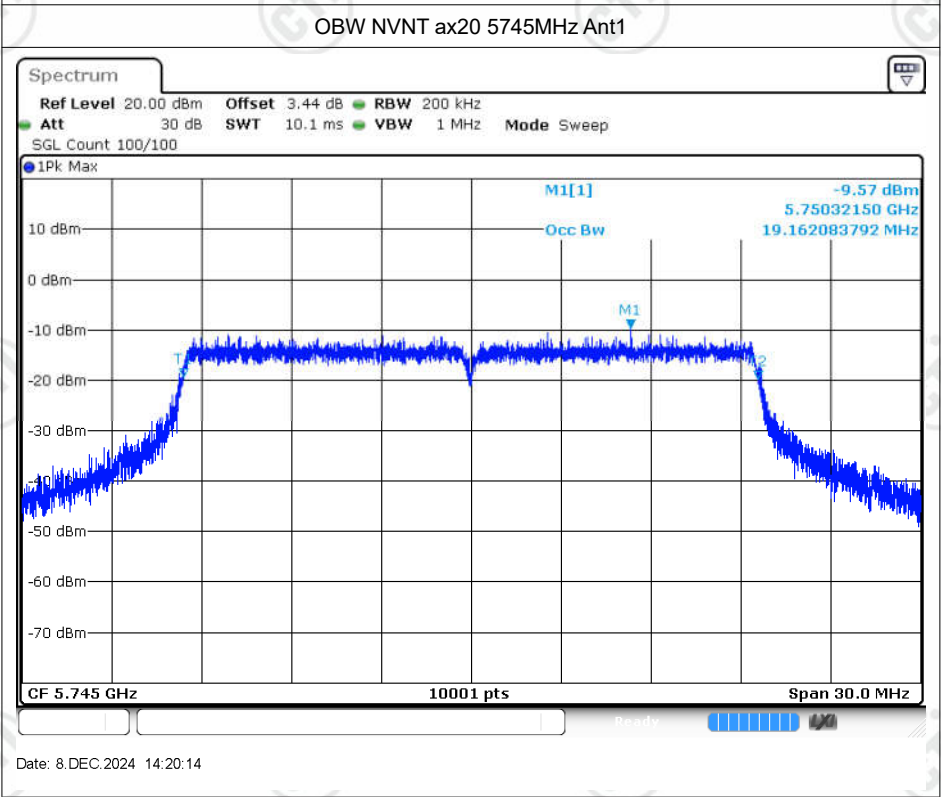


Date: 8.DEC.2024 14:20:14




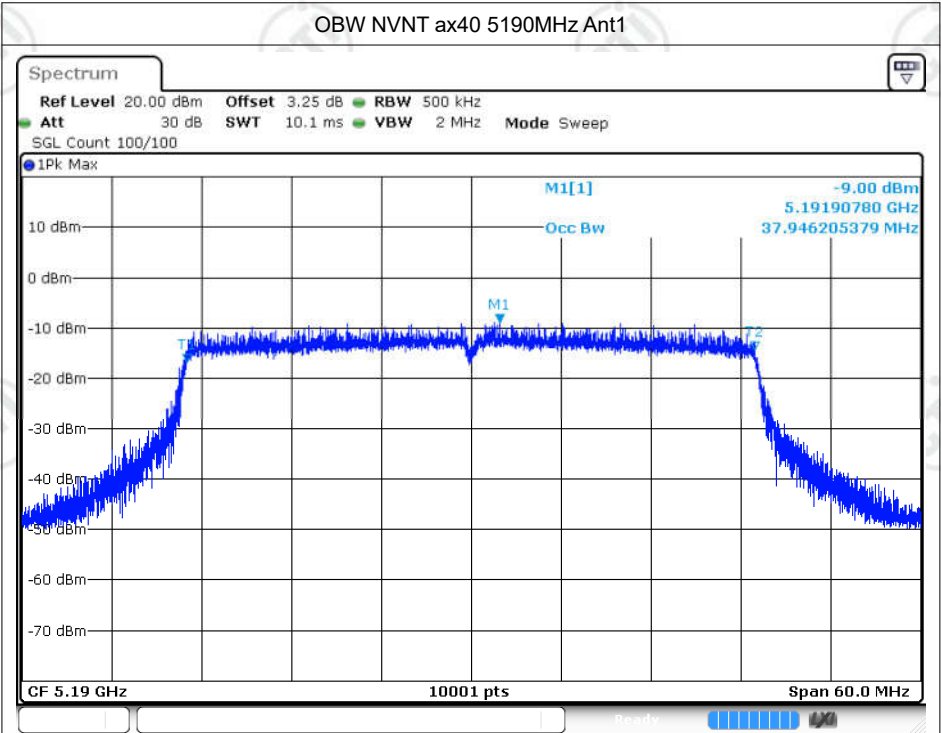


Date: 8.DEC.2024 14:26:43

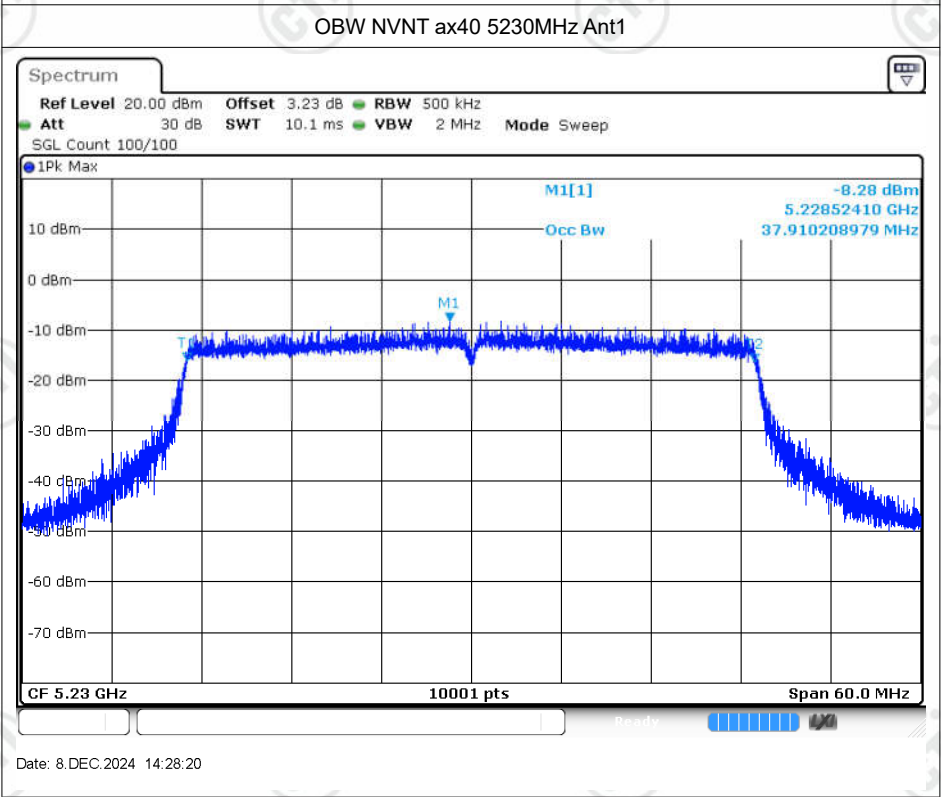

Date: 8.DEC.2024 14:28:20

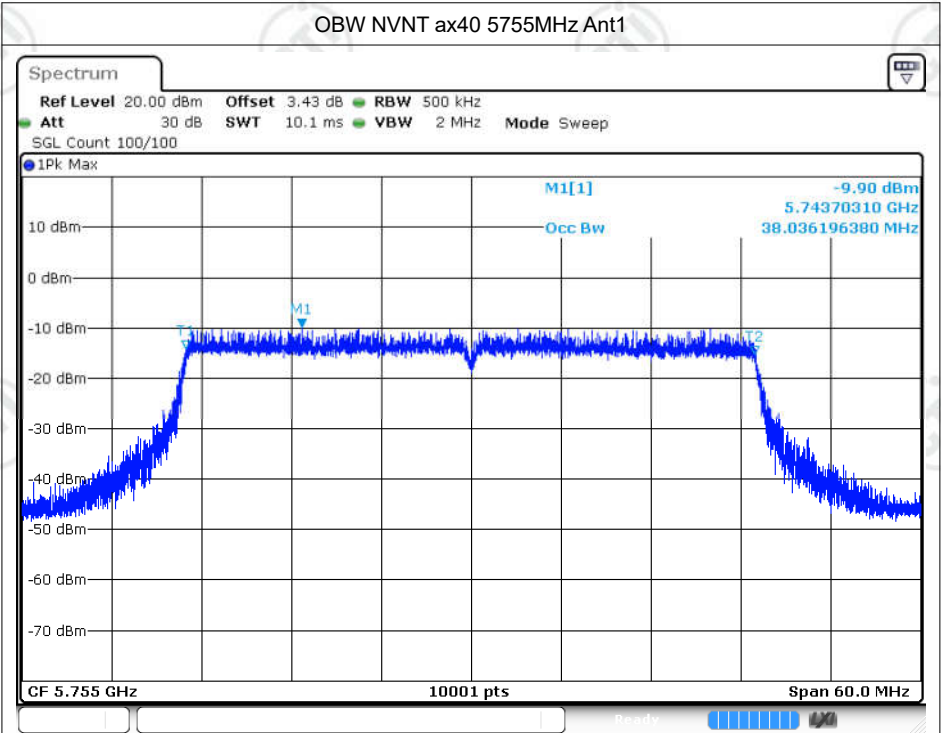



Date: 8.DEC.2024 14:30:17

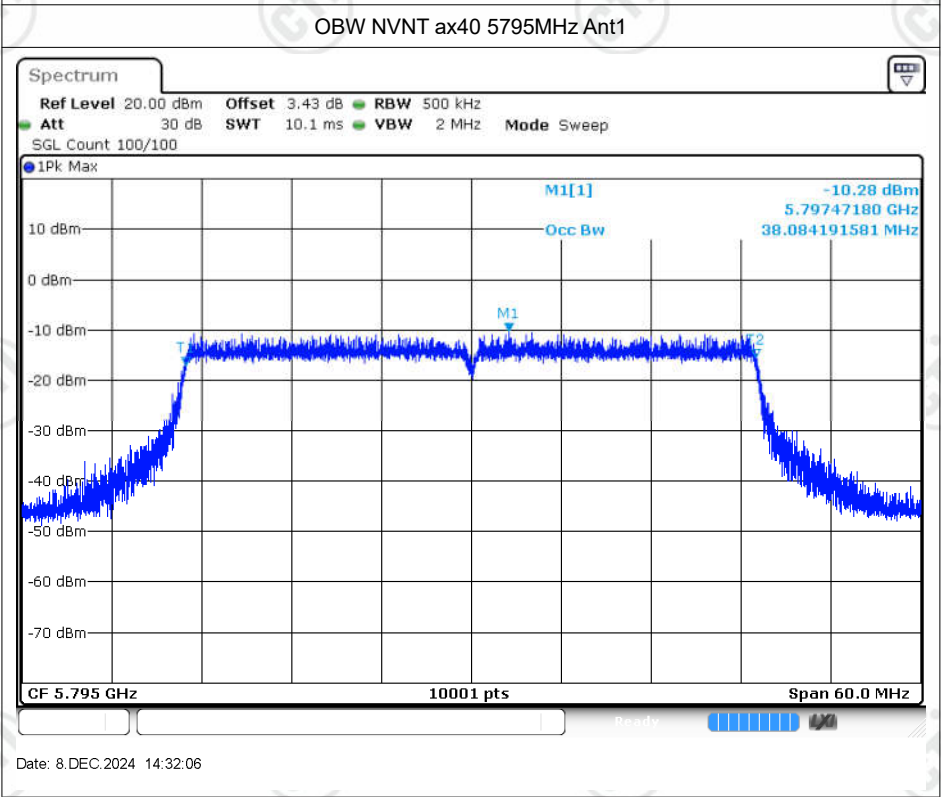


Date: 8.DEC.2024 14:32:06


## Maximum Power Spectral Density Level

| Condition | Mode | Frequency (MHz) | Antenna | Conducted PSD (dBm) | Duty Factor (dB) | Total PSD (dBm) | Limit (dBm) | Verdict |
|-----------|------|-----------------|---------|---------------------|------------------|-----------------|-------------|---------|
| NVNT      | a    | 5180            | Ant1    | -28.12              | 2.38             | -25.74          | 11          | Pass    |
| NVNT      | a    | 5200            | Ant1    | -28.92              | 2.38             | -26.54          | 11          | Pass    |
| NVNT      | a    | 5240            | Ant1    | -29.52              | 2.38             | -27.14          | 11          | Pass    |
| NVNT      | a    | 5745            | Ant1    | -32.07              | 2.38             | -29.69          | 30          | Pass    |
| NVNT      | a    | 5785            | Ant1    | -32.72              | 2.38             | -30.34          | 30          | Pass    |
| NVNT      | a    | 5825            | Ant1    | -31.16              | 2.38             | -28.78          | 30          | Pass    |
| NVNT      | n20  | 5180            | Ant1    | -16.74              | 0.79             | -15.95          | 11          | Pass    |
| NVNT      | n20  | 5200            | Ant1    | -17.77              | 0.79             | -16.98          | 11          | Pass    |
| NVNT      | n20  | 5240            | Ant1    | -19.42              | 0.79             | -18.63          | 11          | Pass    |
| NVNT      | n20  | 5745            | Ant1    | -21.5               | 0.8              | -20.7           | 30          | Pass    |
| NVNT      | n20  | 5785            | Ant1    | -23.07              | 0.8              | -22.27          | 30          | Pass    |
| NVNT      | n20  | 5825            | Ant1    | -21.93              | 0.79             | -21.14          | 30          | Pass    |
| NVNT      | n40  | 5190            | Ant1    | -26.33              | 1.5              | -24.83          | 11          | Pass    |
| NVNT      | n40  | 5230            | Ant1    | -25.24              | 1.5              | -23.74          | 11          | Pass    |
| NVNT      | n40  | 5755            | Ant1    | -29.65              | 1.5              | -28.15          | 30          | Pass    |
| NVNT      | n40  | 5795            | Ant1    | -30                 | 1.5              | -28.5           | 30          | Pass    |
| NVNT      | ac20 | 5180            | Ant1    | -19.44              | 0.79             | -18.65          | 11          | Pass    |
| NVNT      | ac20 | 5200            | Ant1    | -18.79              | 0.79             | -18             | 11          | Pass    |
| NVNT      | ac20 | 5240            | Ant1    | -18.15              | 0.79             | -17.36          | 11          | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | -21.21              | 0.79             | -20.42          | 30          | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | -23.22              | 0.79             | -22.43          | 30          | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | -21.67              | 0.79             | -20.88          | 30          | Pass    |
| NVNT      | ac40 | 5190            | Ant1    | -25.97              | 1.5              | -24.47          | 11          | Pass    |
| NVNT      | ac40 | 5230            | Ant1    | -25.43              | 1.5              | -23.93          | 11          | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | -28.92              | 1.5              | -27.42          | 30          | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | -28.69              | 1.5              | -27.19          | 30          | Pass    |
| NVNT      | ax20 | 5180            | Ant1    | -19.86              | 1.01             | -18.85          | 11          | Pass    |
| NVNT      | ax20 | 5200            | Ant1    | -22.01              | 1.01             | -21             | 11          | Pass    |
| NVNT      | ax20 | 5240            | Ant1    | -21.63              | 1.01             | -20.62          | 11          | Pass    |
| NVNT      | ax20 | 5745            | Ant1    | -23.45              | 1.01             | -22.44          | 30          | Pass    |
| NVNT      | ax20 | 5785            | Ant1    | -25.04              | 1.01             | -24.03          | 30          | Pass    |
| NVNT      | ax20 | 5825            | Ant1    | -23.89              | 1.02             | -22.87          | 30          | Pass    |
| NVNT      | ax40 | 5190            | Ant1    | -28.12              | 1.81             | -26.31          | 11          | Pass    |
| NVNT      | ax40 | 5230            | Ant1    | -28.37              | 1.8              | -26.57          | 11          | Pass    |
| NVNT      | ax40 | 5755            | Ant1    | -31.04              | 1.81             | -29.23          | 30          | Pass    |
| NVNT      | ax40 | 5795            | Ant1    | -30.51              | 1.82             | -28.69          | 30          | Pass    |

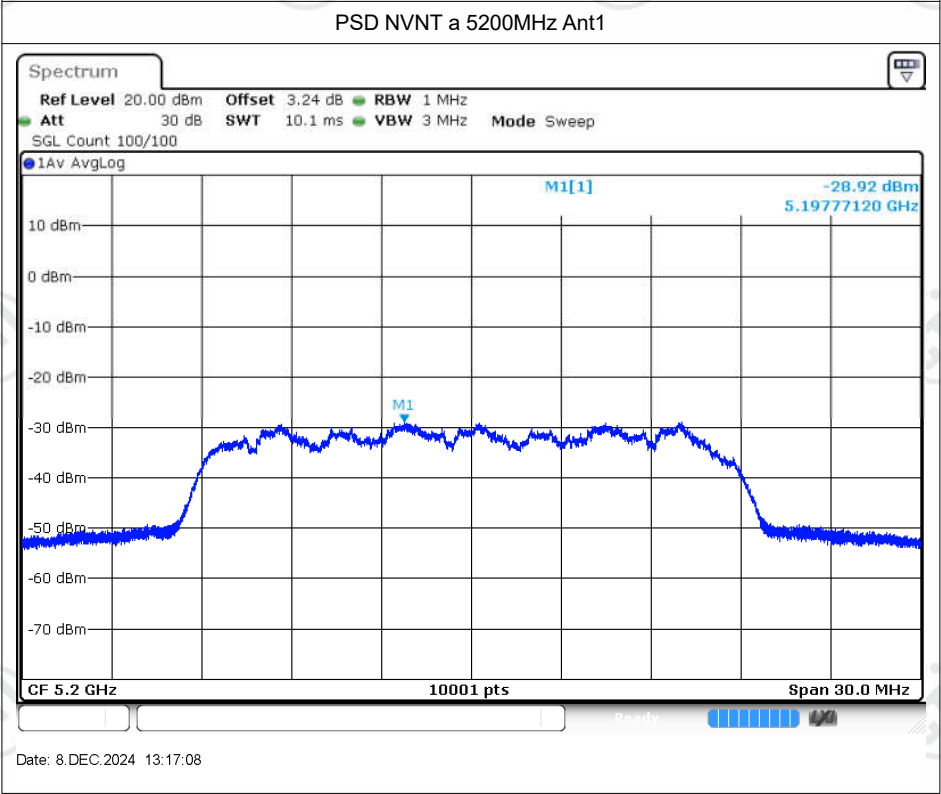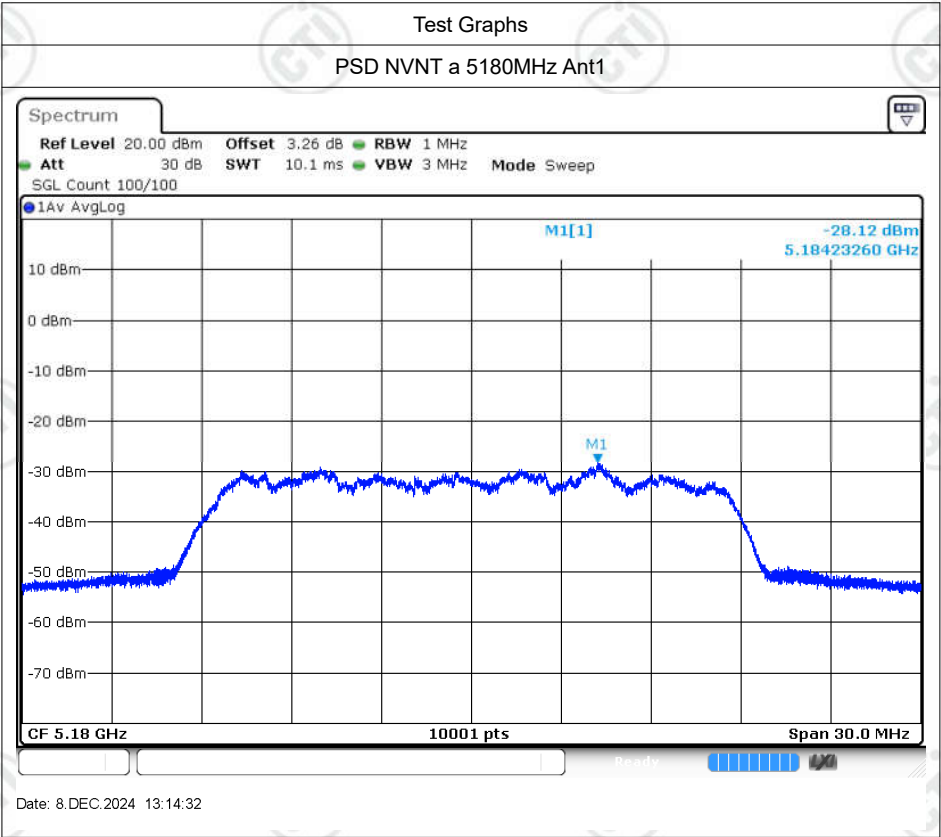


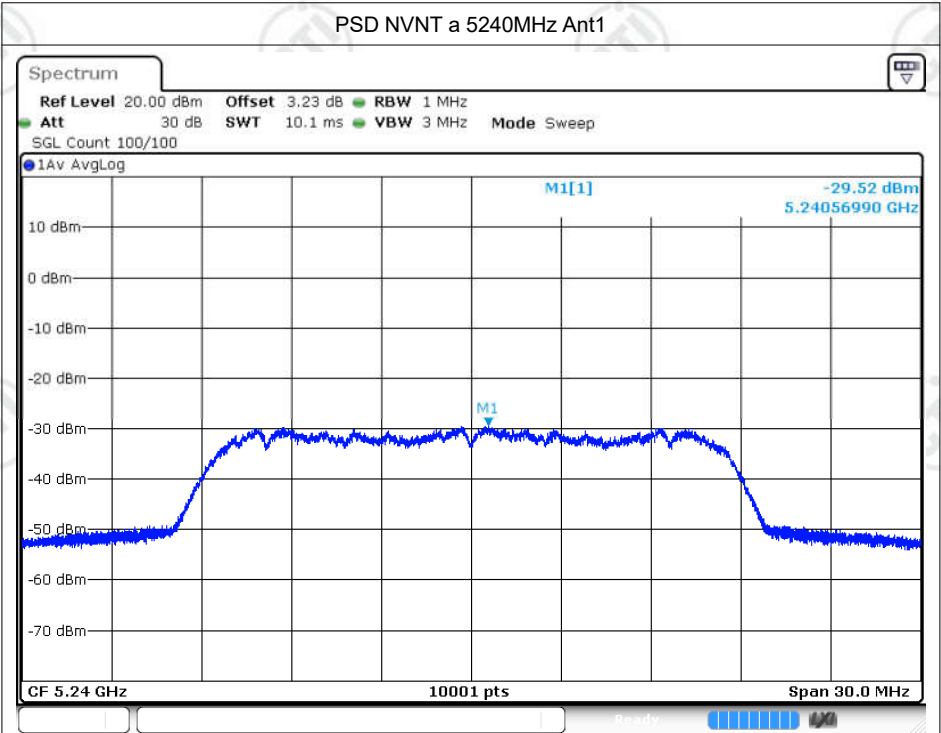


Date: 8.DEC.2024 13:19:01

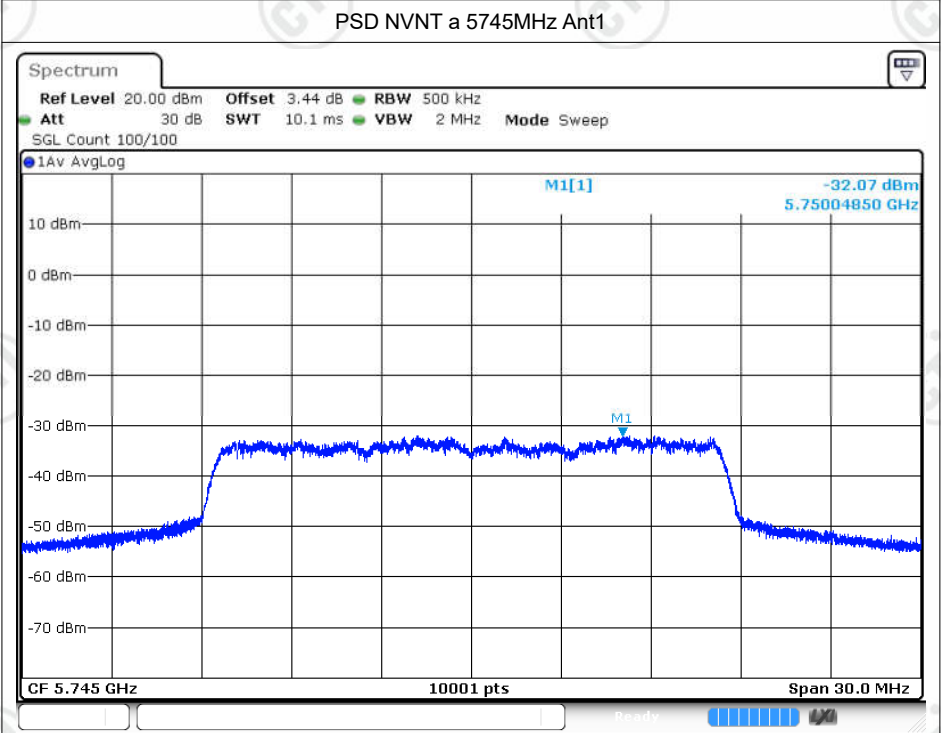


Date: 8.DEC.2024 13:21:25

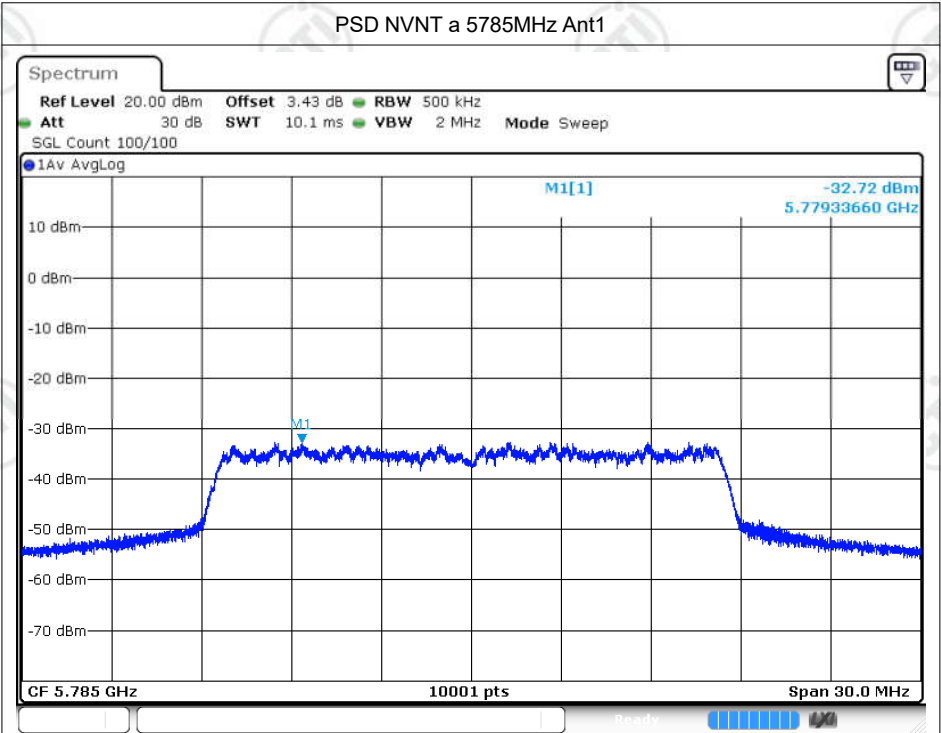


Date: 8.DEC.2024 13:23:54

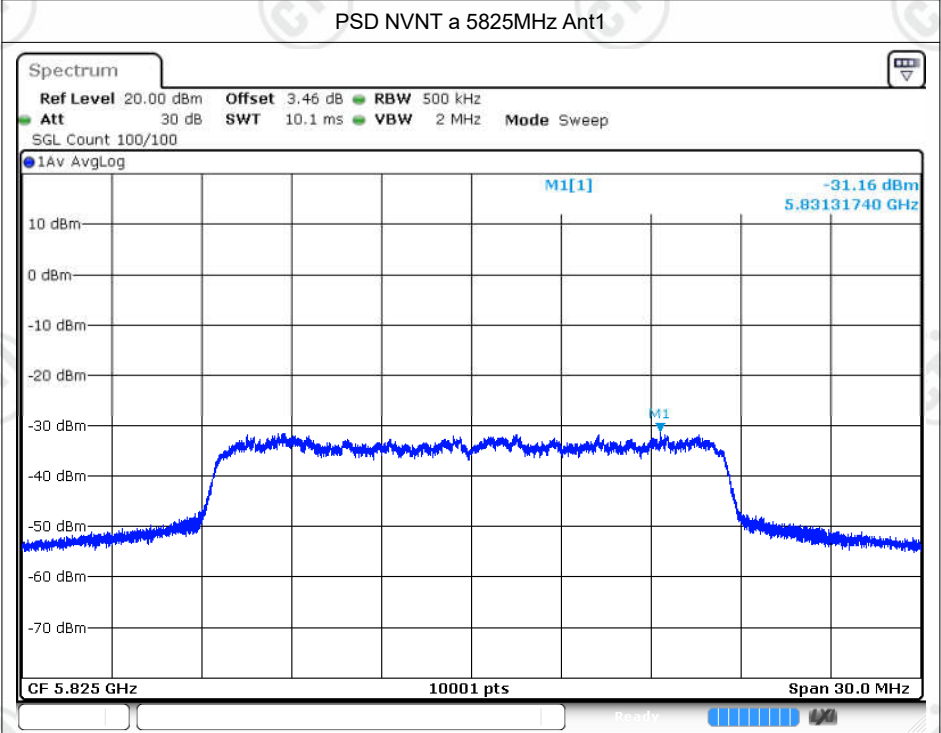


Date: 8.DEC.2024 13:26:07

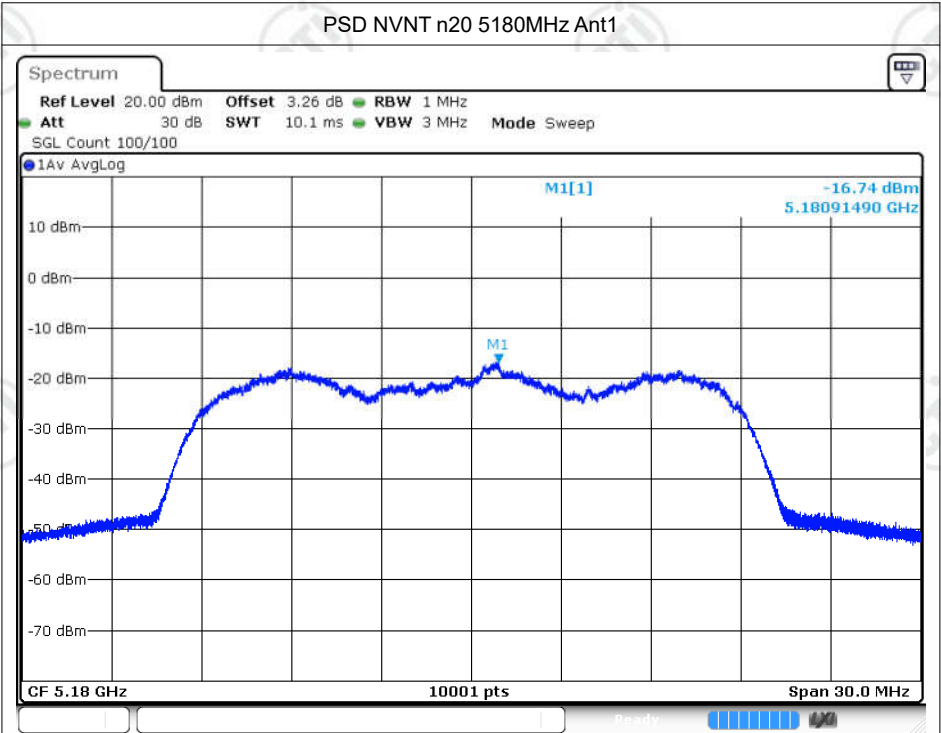


Date: 8.DEC.2024 13:29:42

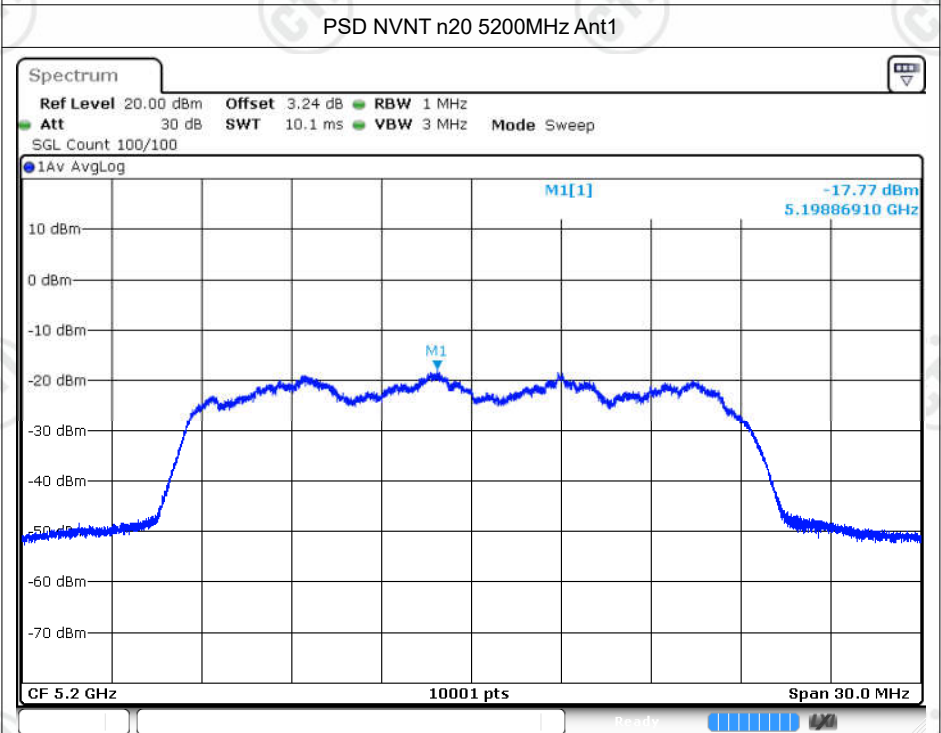


Date: 8.DEC.2024 13:31:50

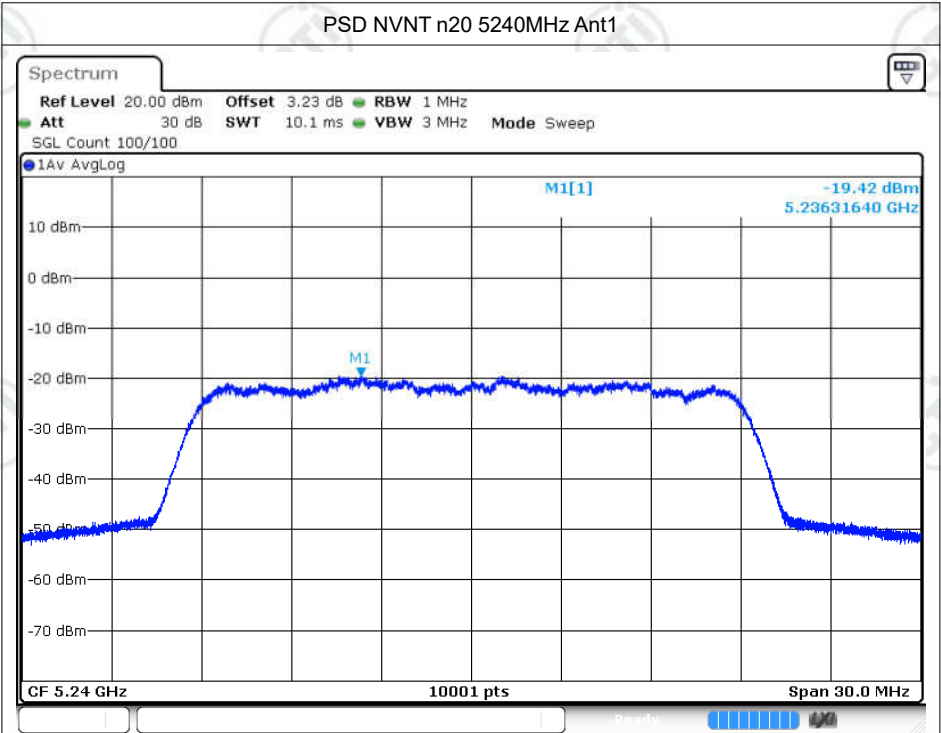


Date: 8.DEC.2024 13:34:24

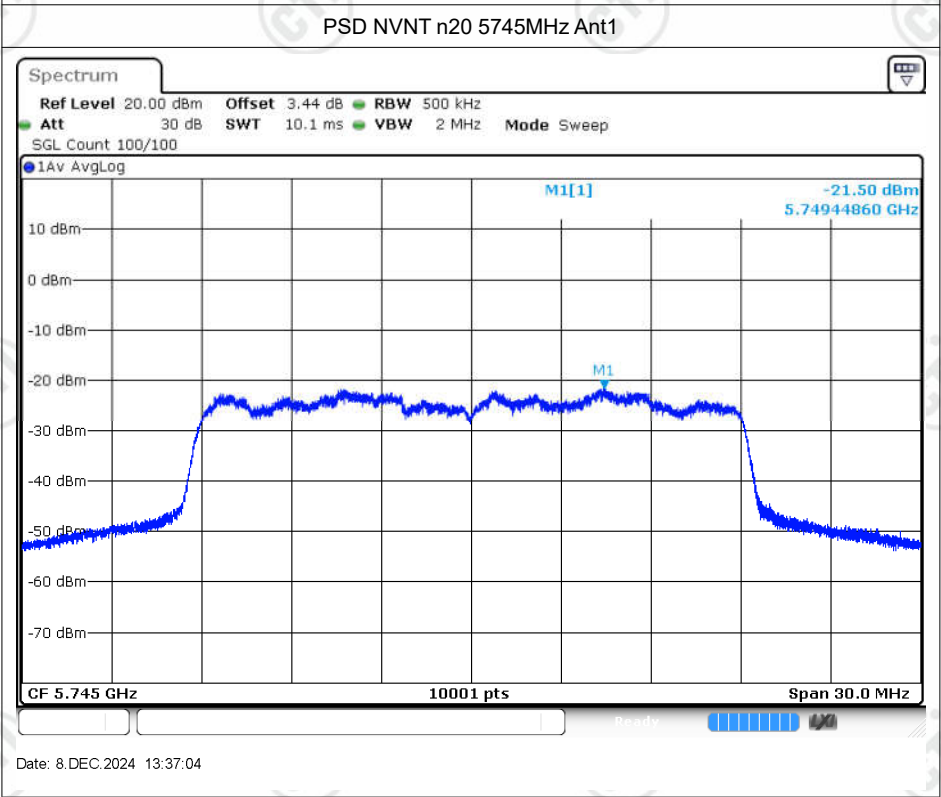


Date: 8.DEC.2024 13:37:04

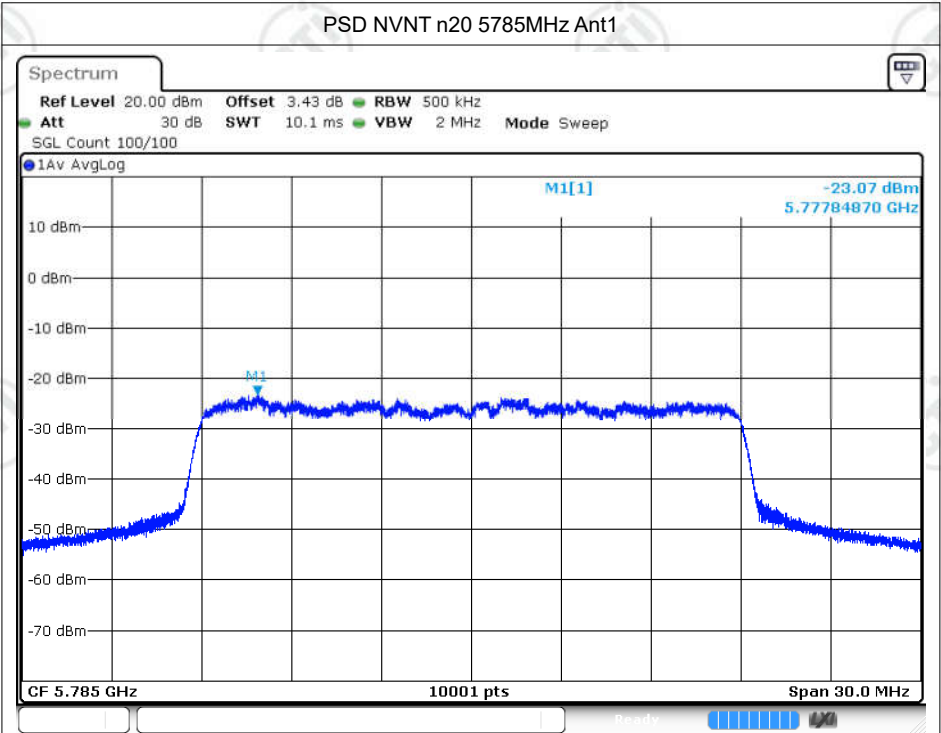


Date: 8.DEC.2024 13:38:48

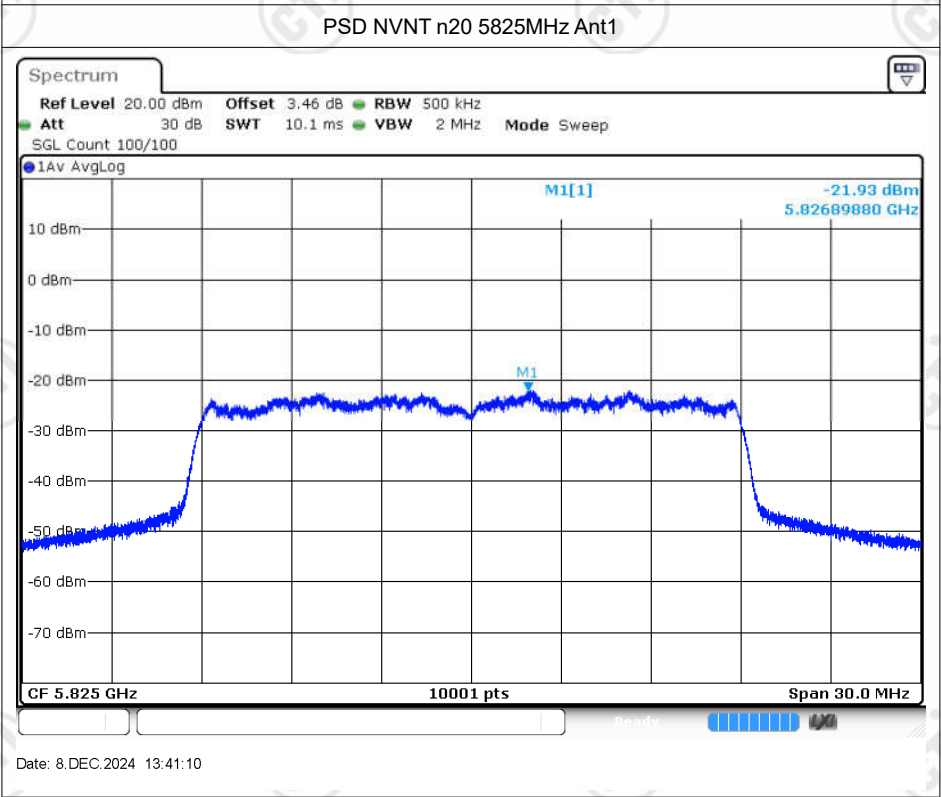


Date: 8.DEC.2024 13:41:10

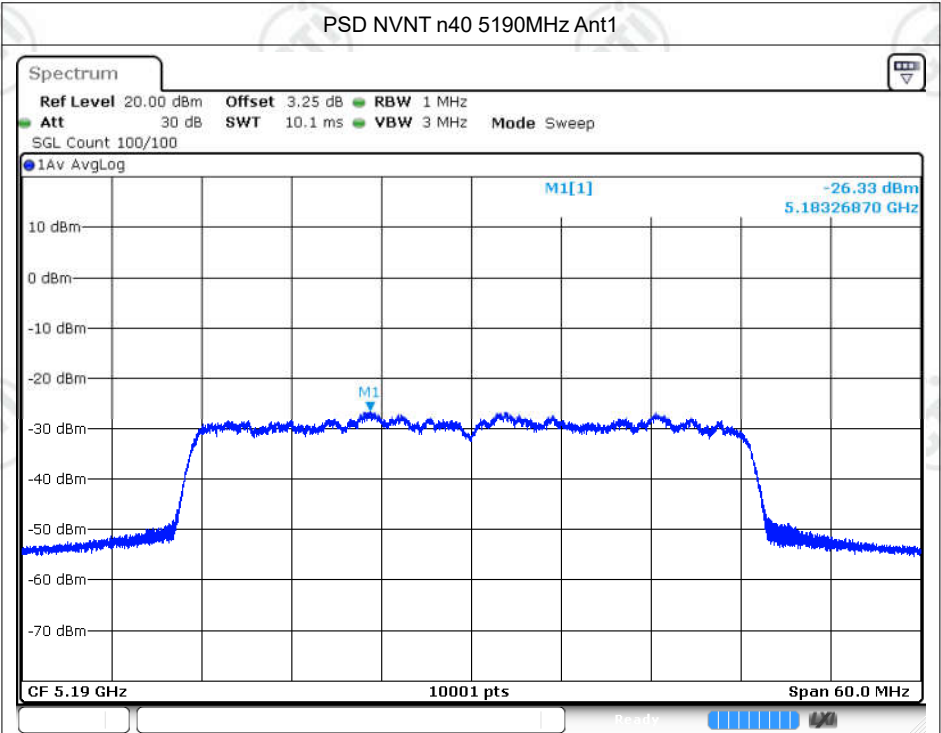


Date: 8.DEC.2024 13:43:18

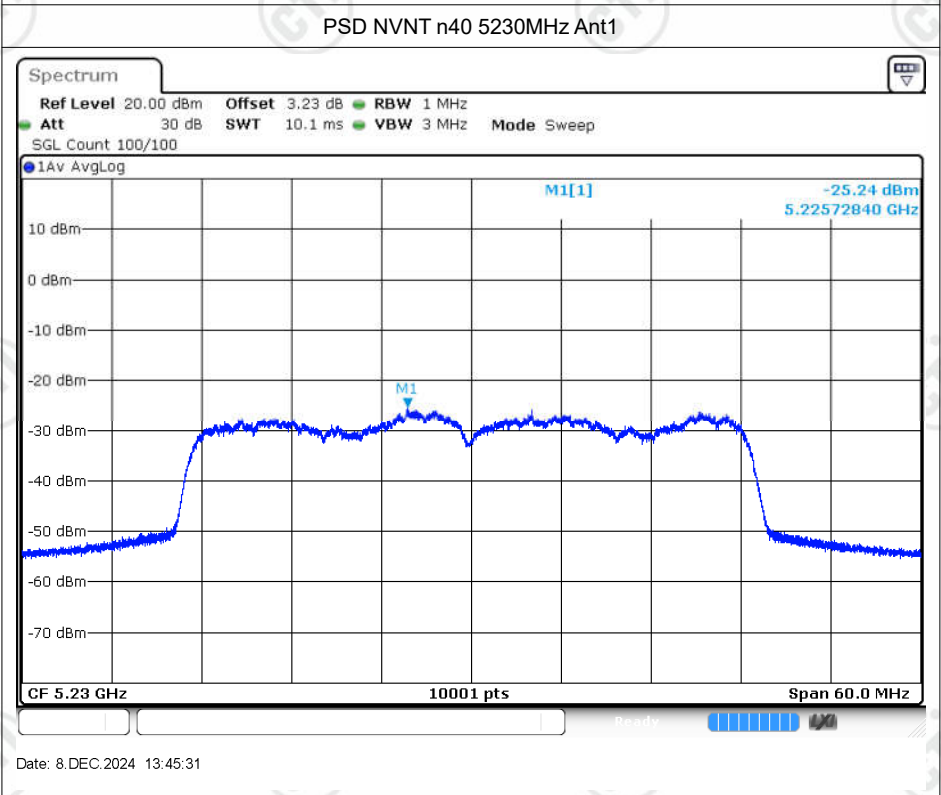


Date: 8.DEC.2024 13:45:31

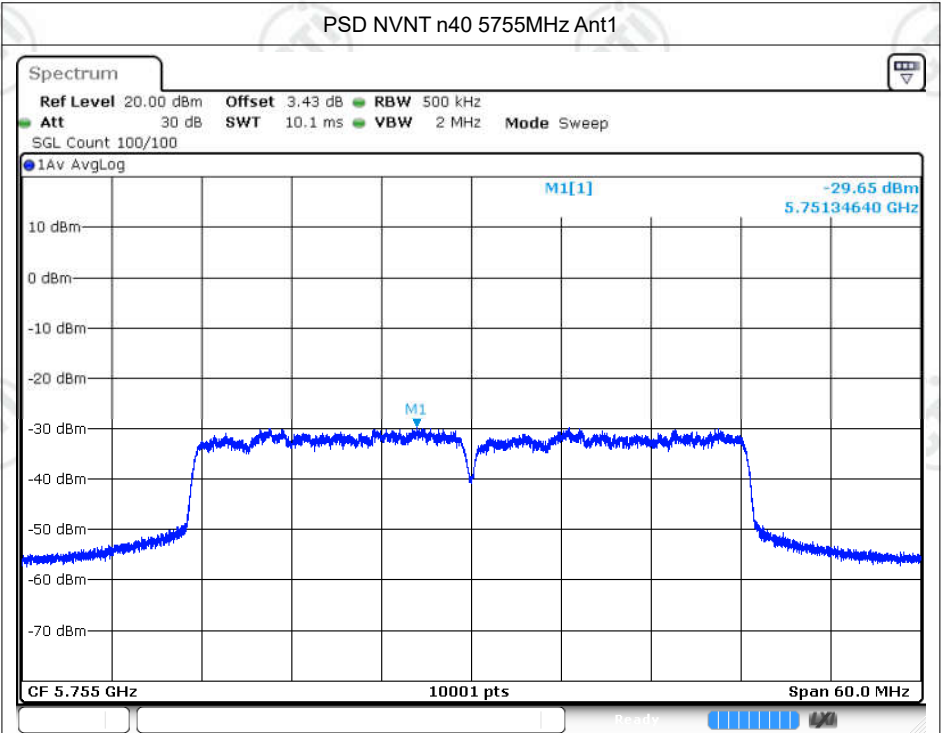


Date: 8.DEC.2024 13:47:28

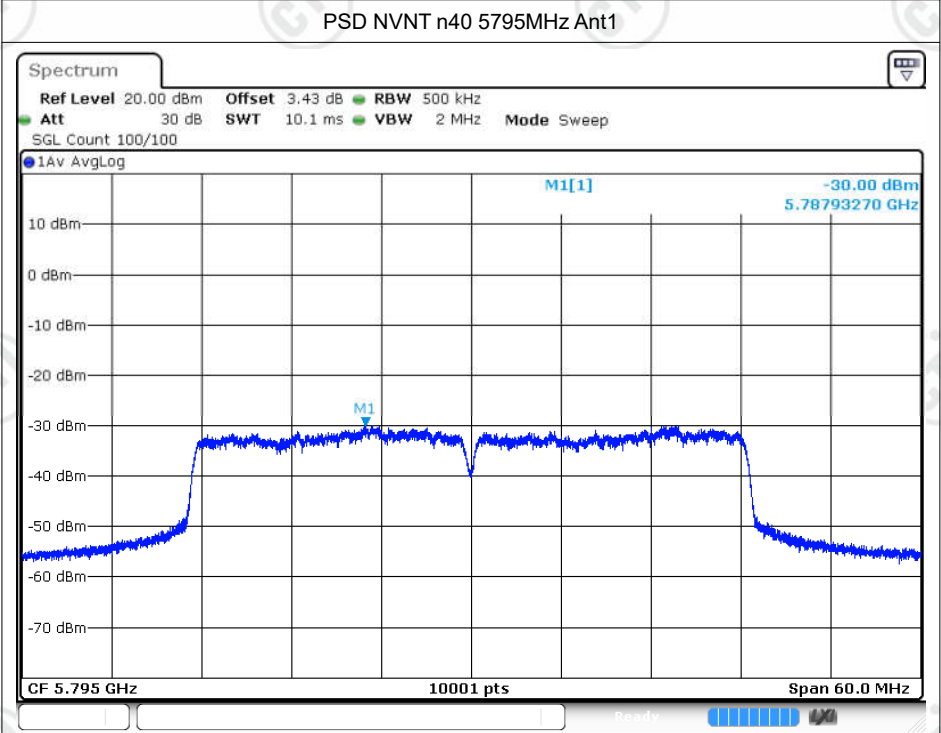


Date: 8.DEC.2024 13:50:04

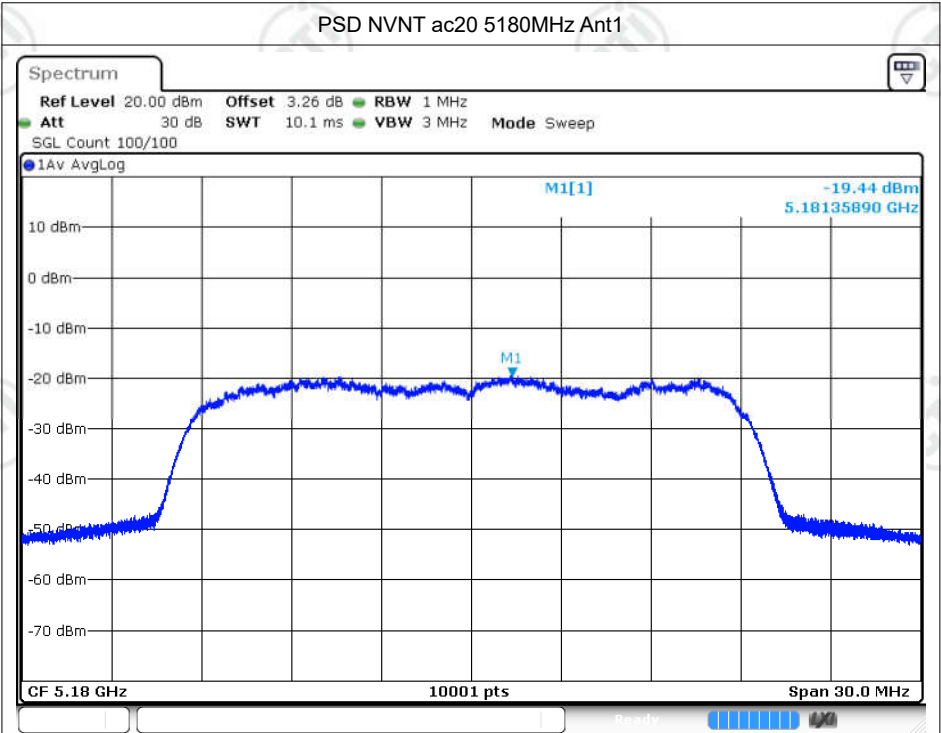


Date: 8.DEC.2024 13:53:13

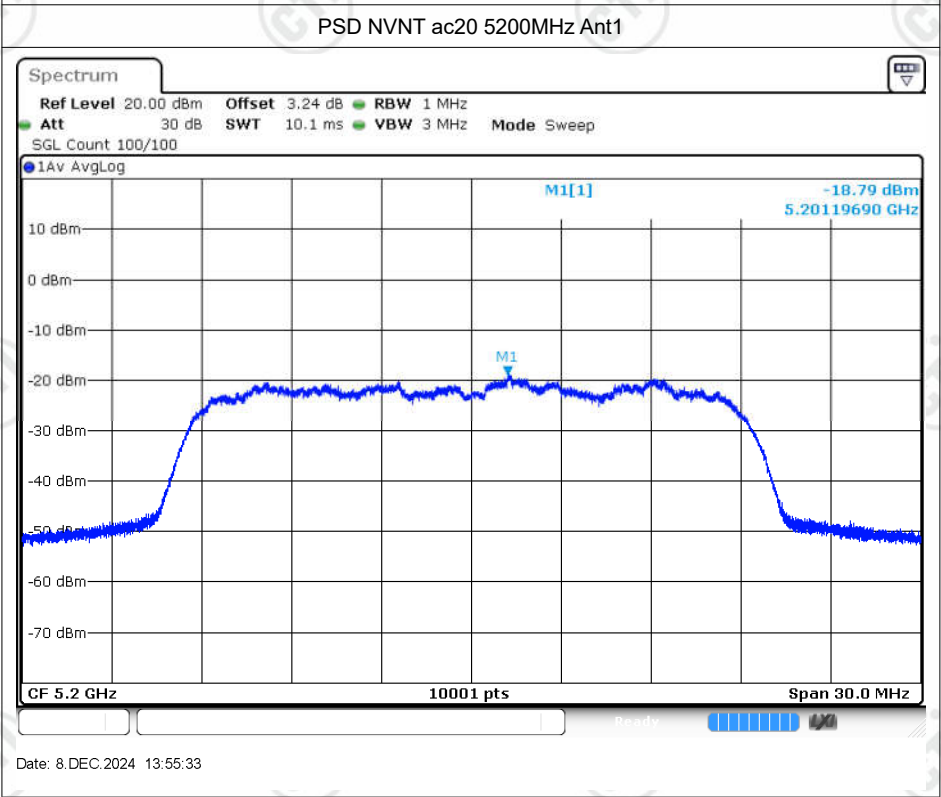


Date: 8.DEC.2024 13:55:33

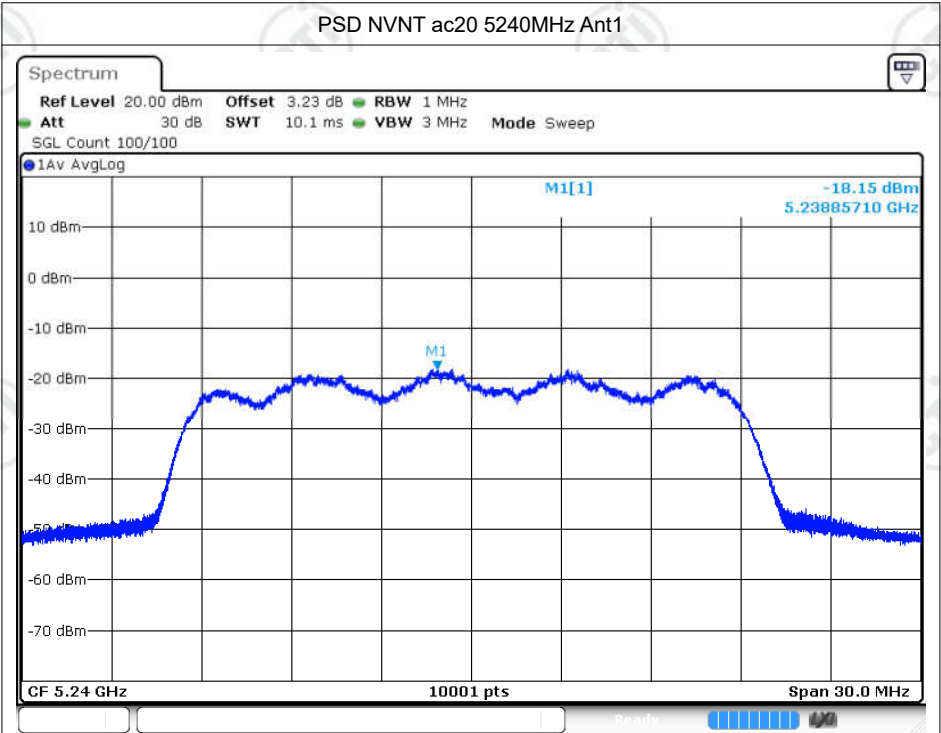


Date: 8.DEC.2024 13:57:40

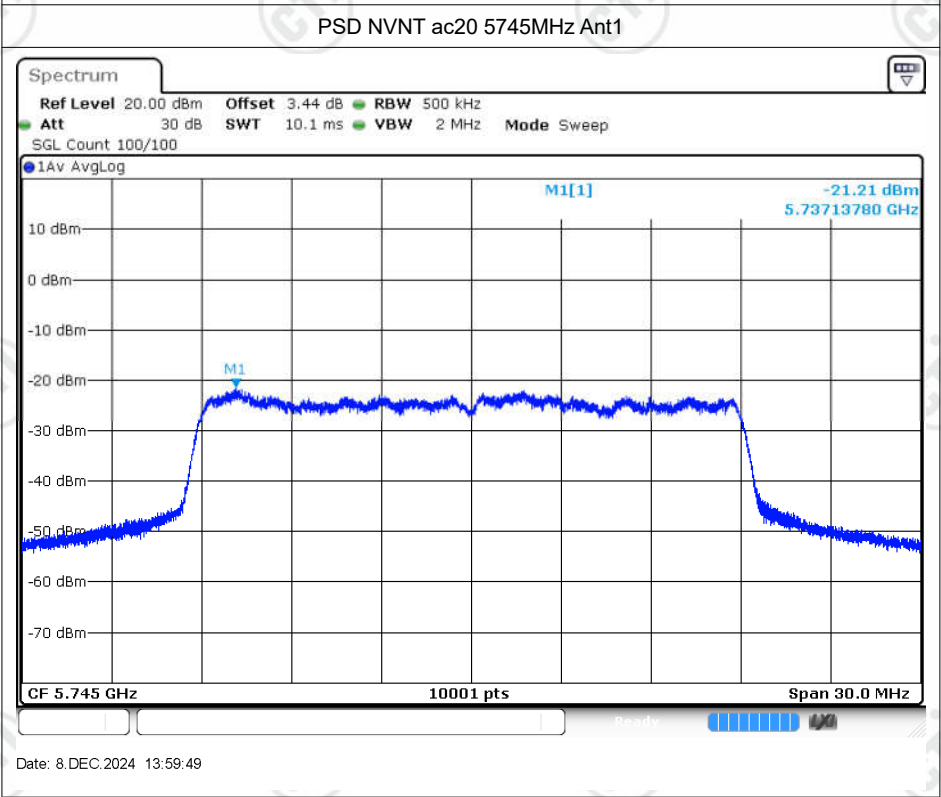


Date: 8.DEC.2024 13:59:49

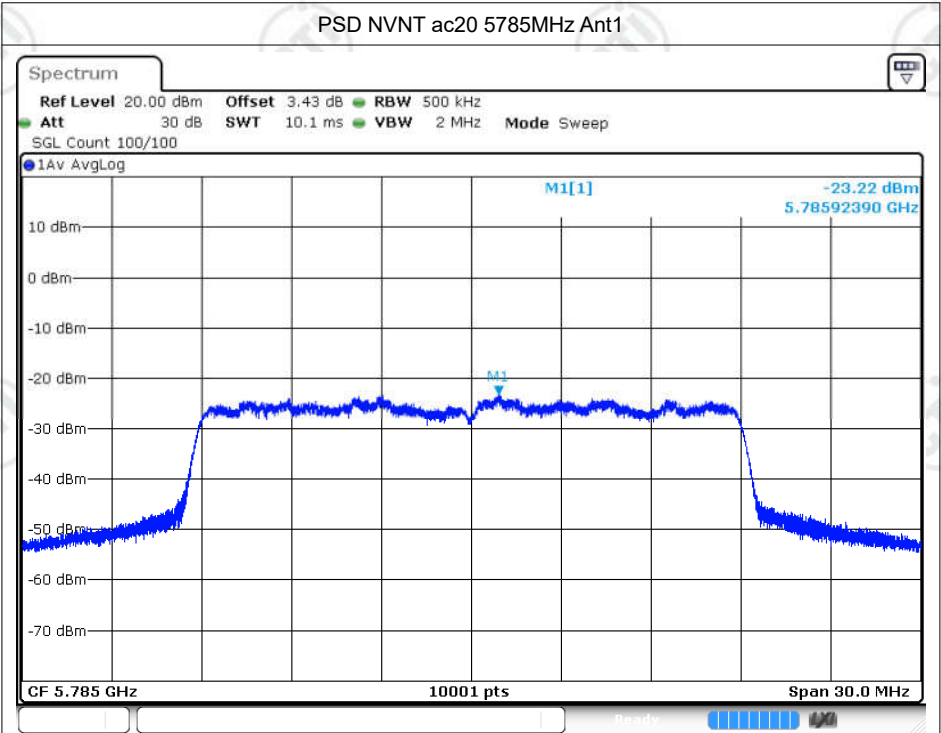


Date: 8.DEC.2024 14:02:12

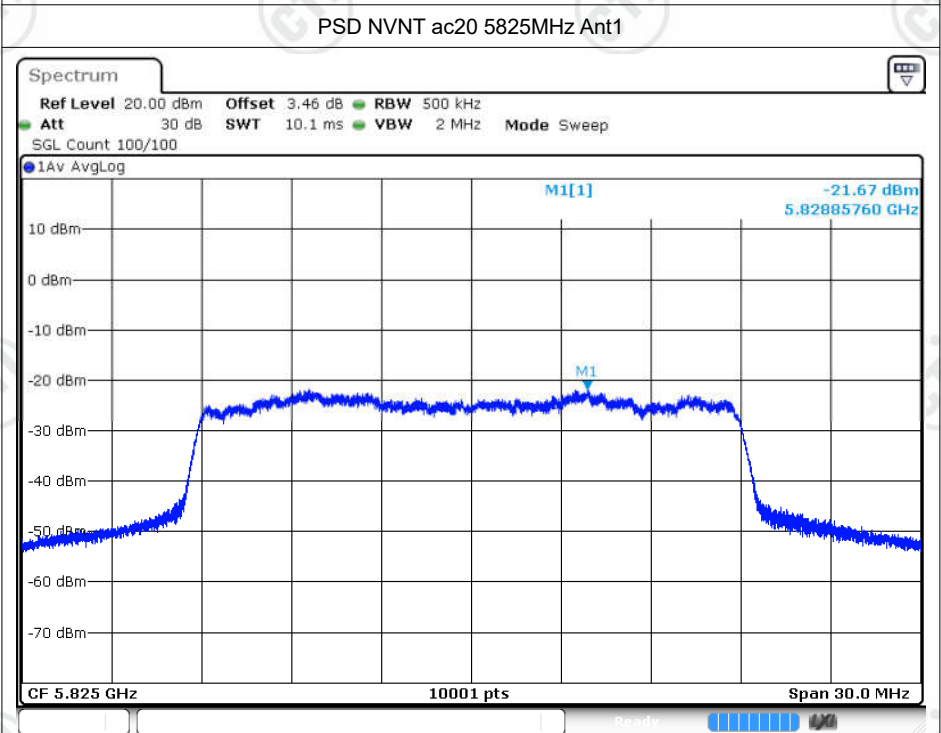


Date: 8.DEC.2024 14:04:10

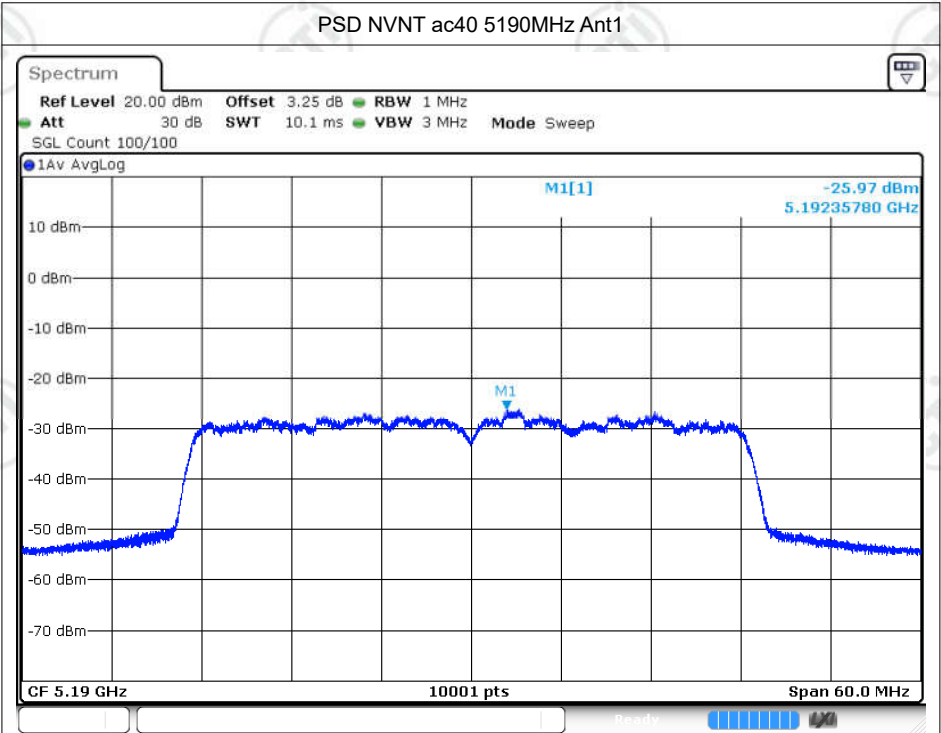


Date: 8.DEC.2024 14:06:11

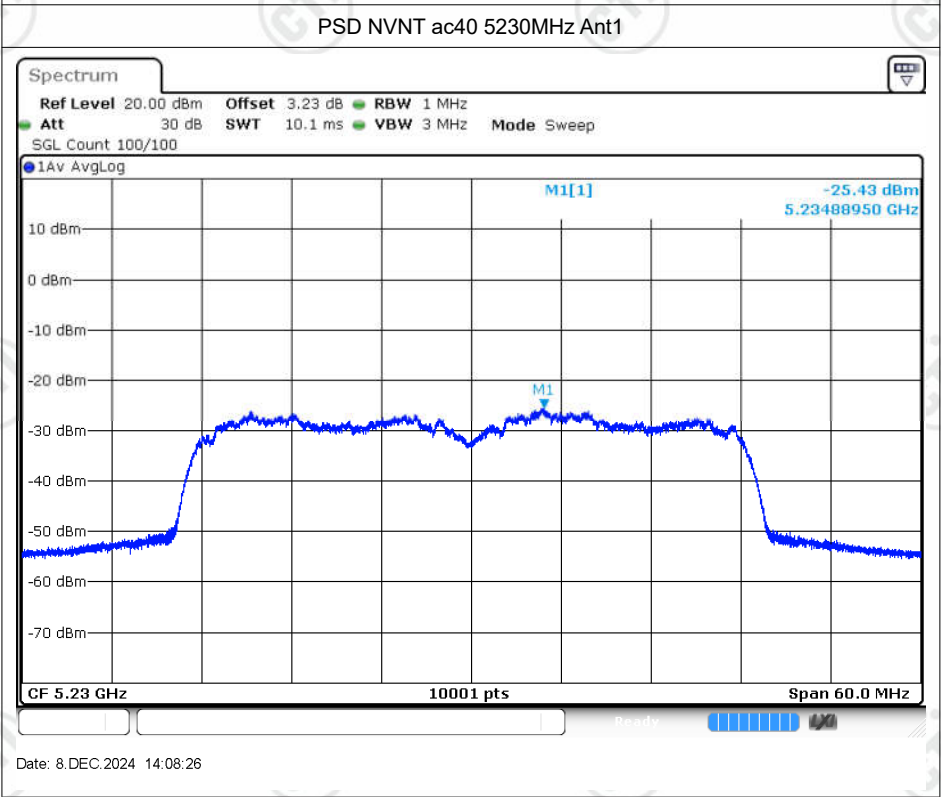


Date: 8.DEC.2024 14:08:26

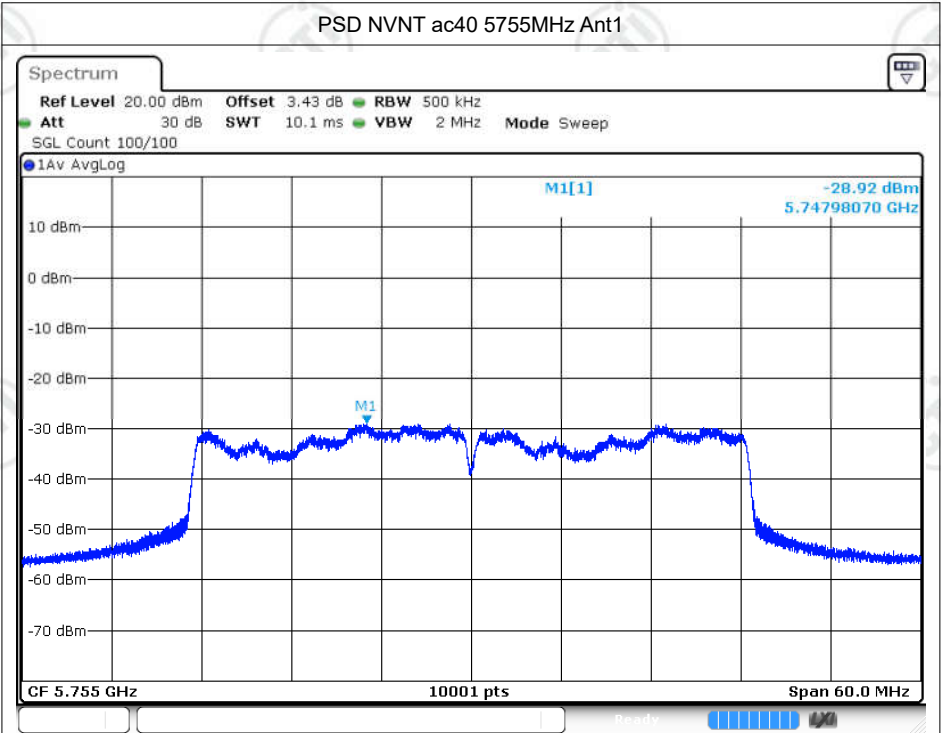


Date: 8.DEC.2024 14:10:24

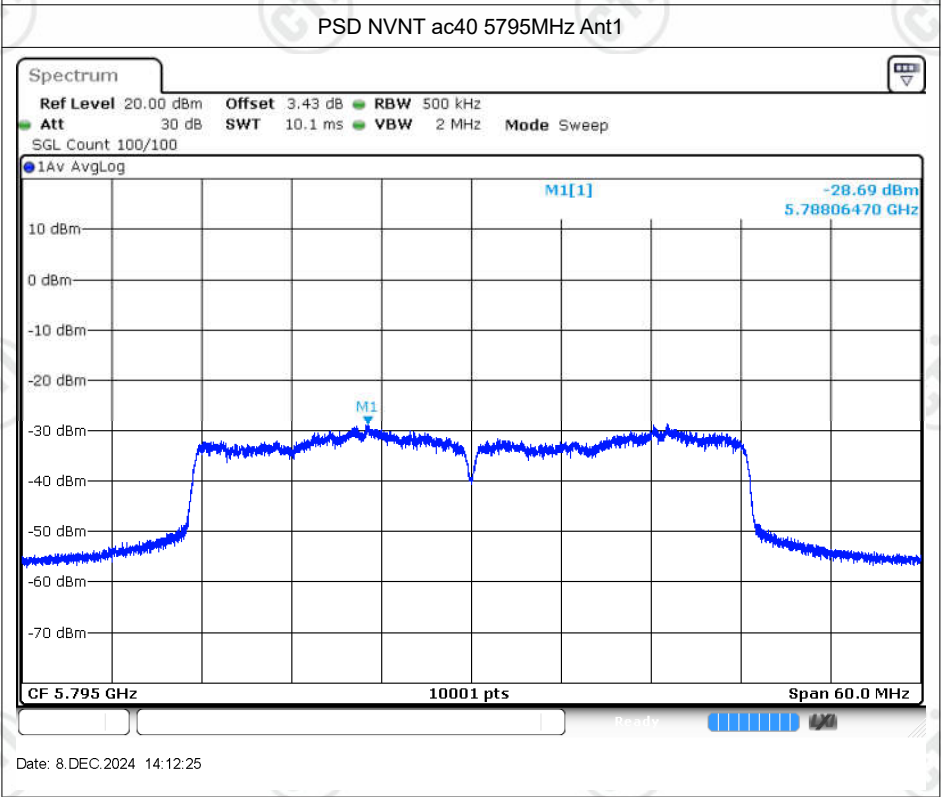


Date: 8.DEC.2024 14:12:25

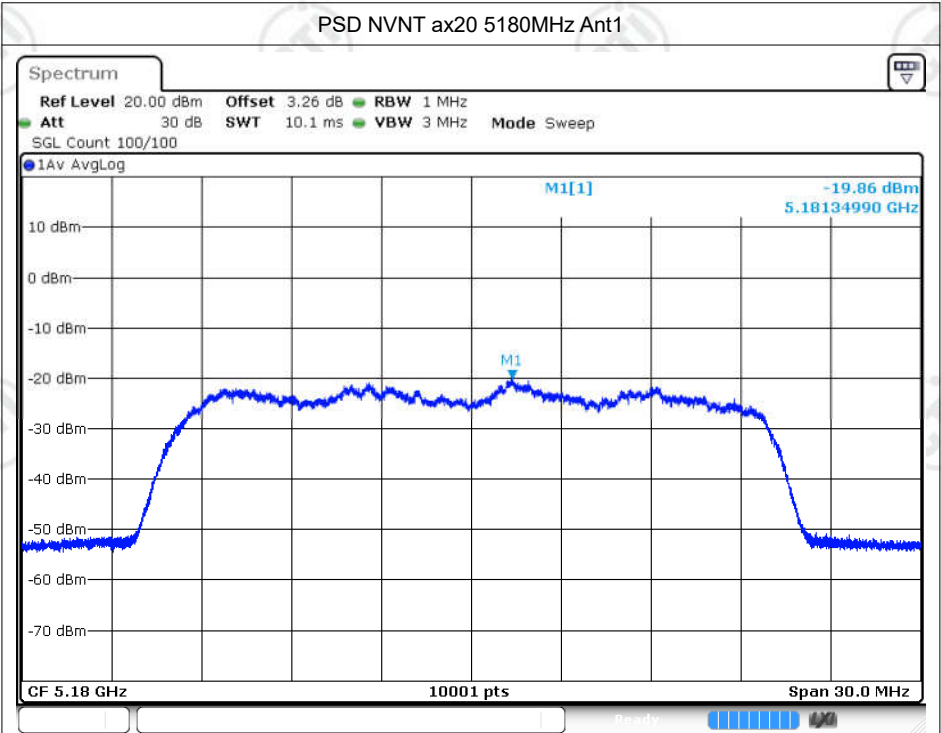


Date: 8.DEC.2024 14:14:48

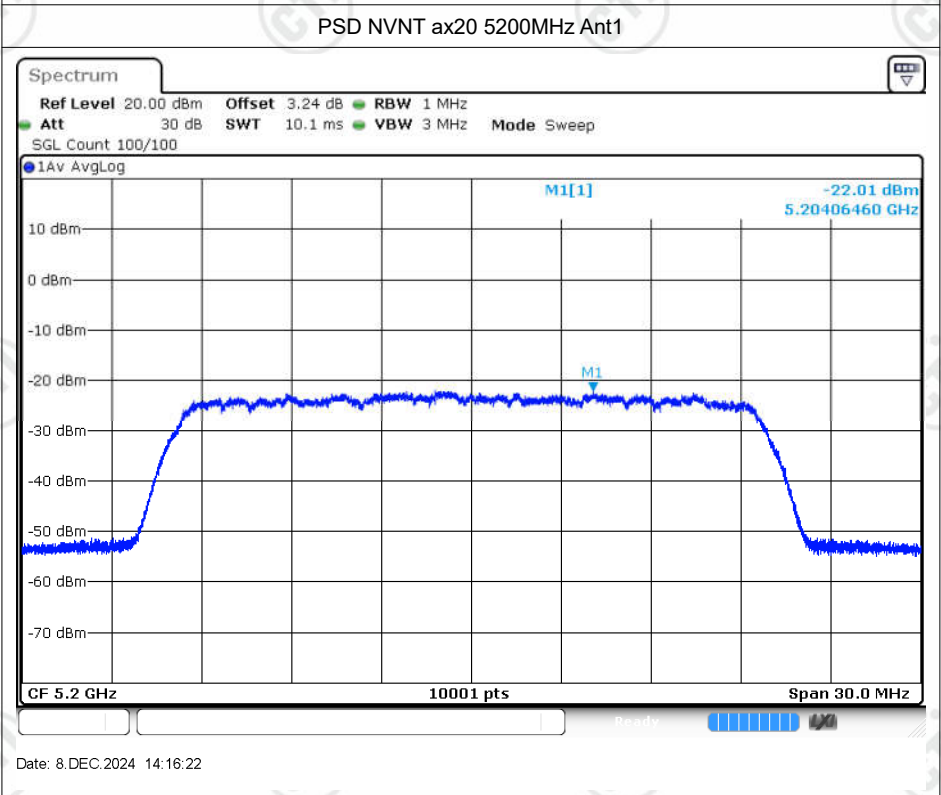


Date: 8.DEC.2024 14:16:22

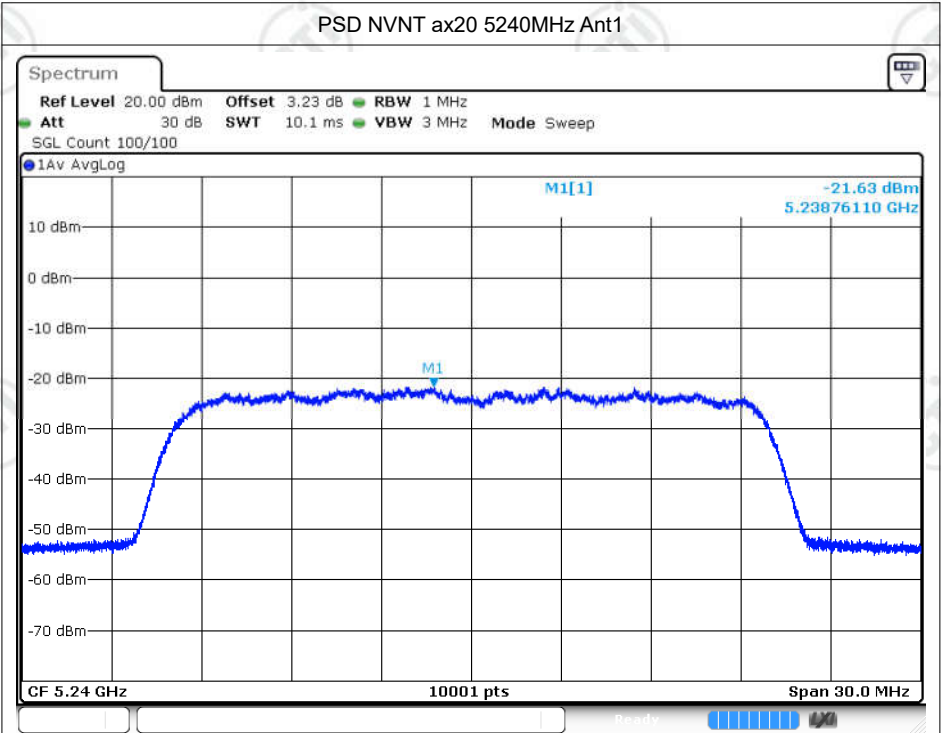


Date: 8.DEC.2024 14:18:35

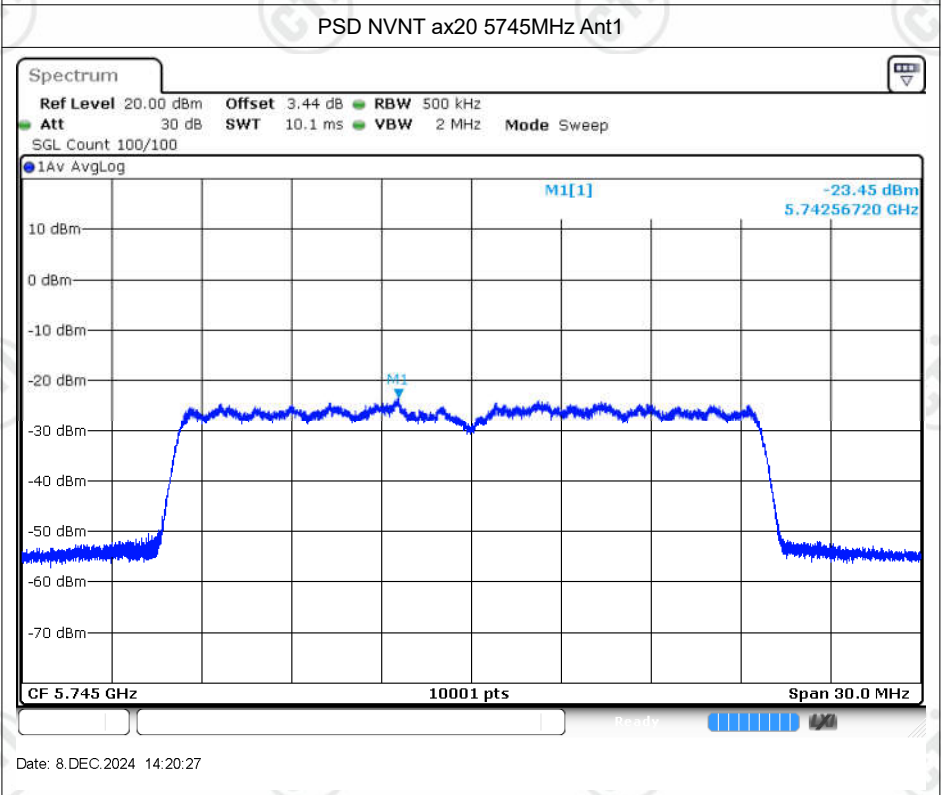


Date: 8.DEC.2024 14:20:27

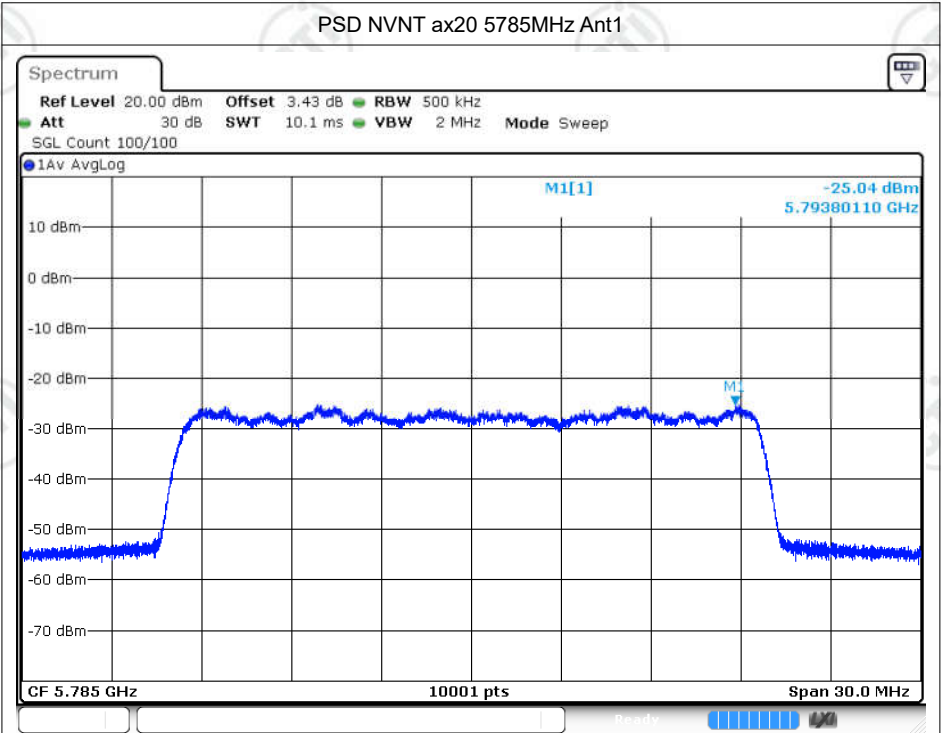


Date: 8.DEC.2024 14:22:22

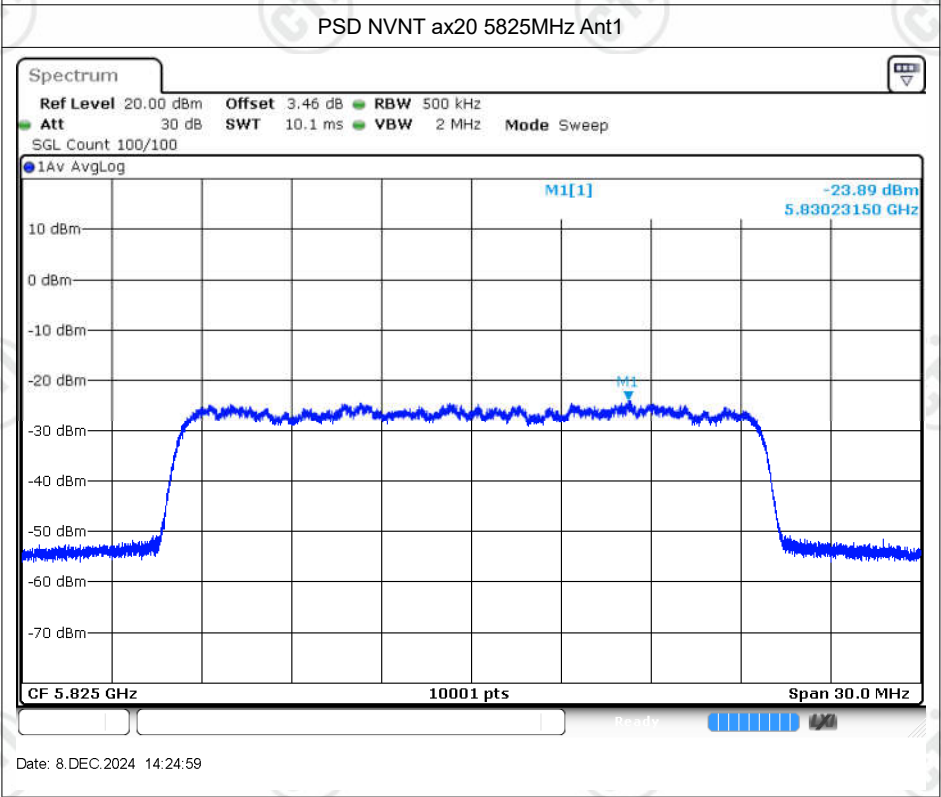


Date: 8.DEC.2024 14:24:59

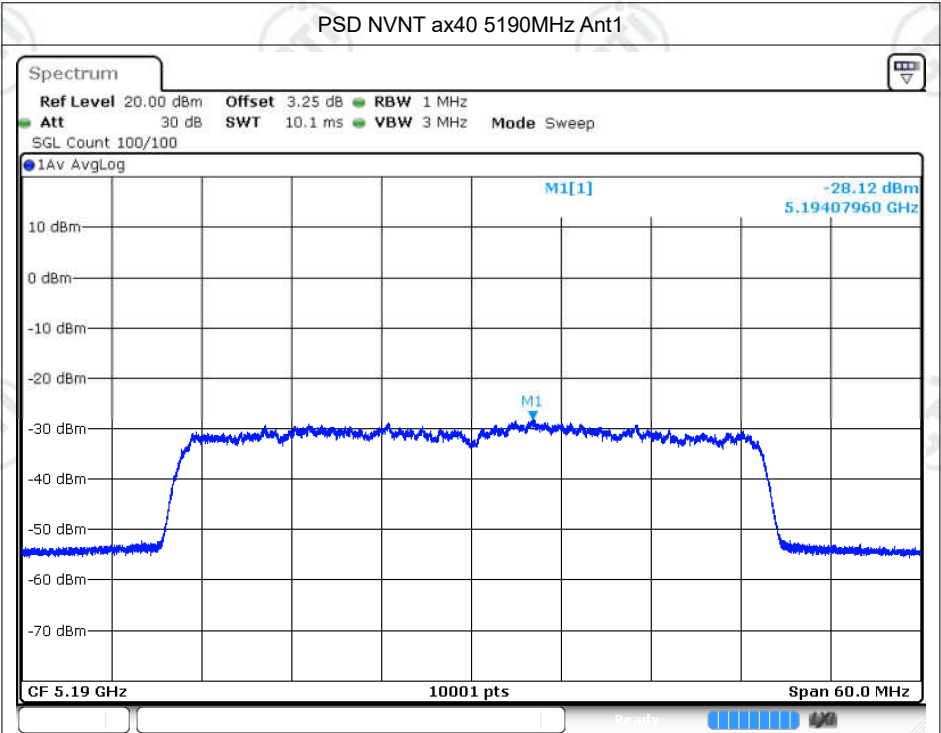


Date: 8.DEC.2024 14:26:55

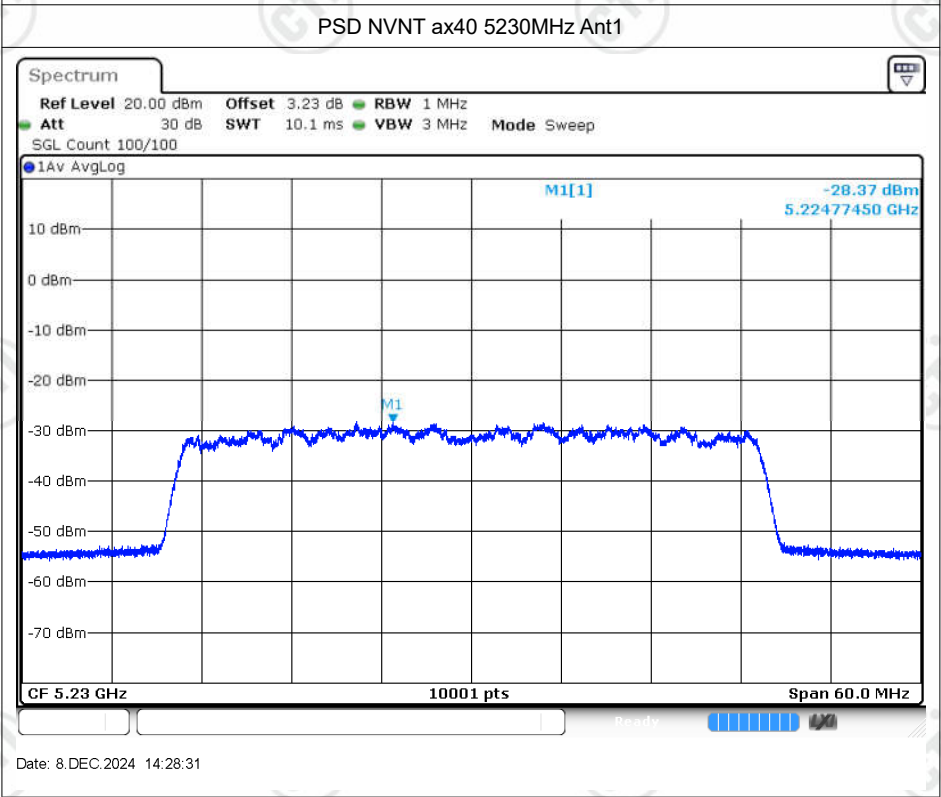

Date: 8.DEC.2024 14:28:31

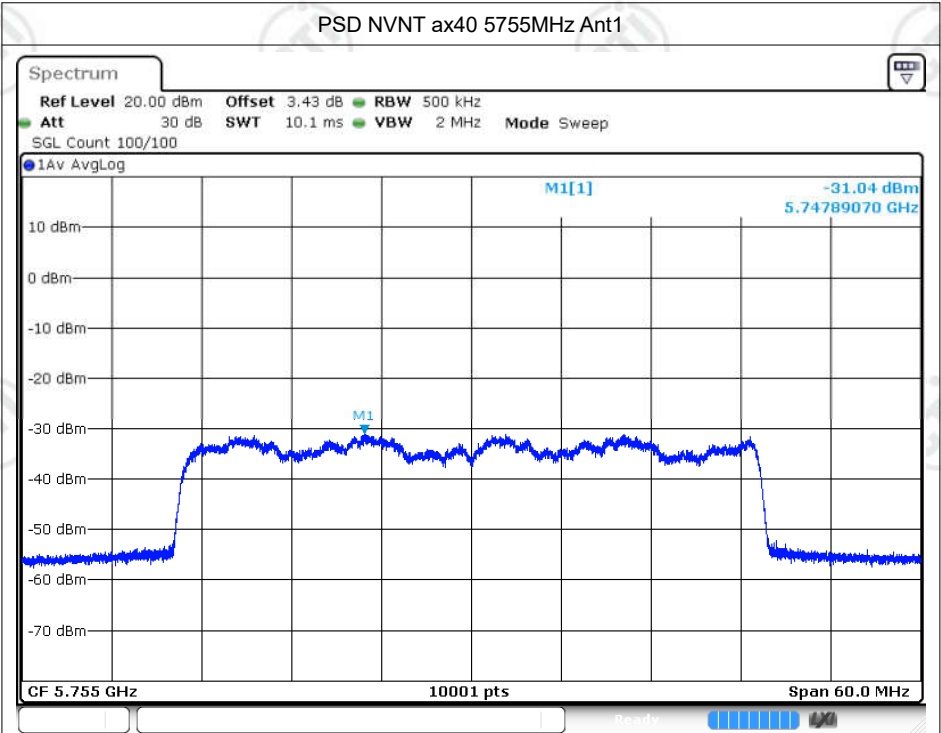

Date: 8.DEC.2024 14:30:27

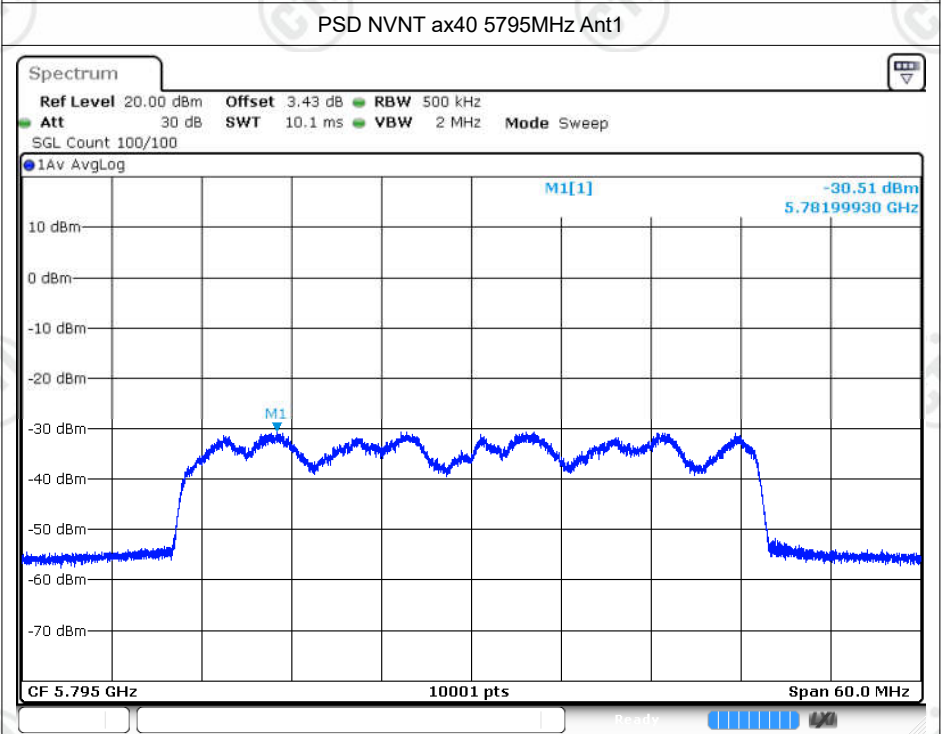

Date: 8.DEC.2024 14:32:17

## Frequency Stability

| Condition | Mode | Frequency<br>(MHz) | Antenna | Measured Frequency<br>(MHz) | Frequency Error<br>(Hz) | Deviation<br>(ppm) | Limit<br>(ppm) | Verdict |
|-----------|------|--------------------|---------|-----------------------------|-------------------------|--------------------|----------------|---------|
| 20C 102V  | a    | 5180               | Ant1    | 5179.96                     | -40000                  | -7.72              | 25             | Pass    |
| 20C 120V  | a    | 5180               | Ant1    | 5179.96                     | -40000                  | -7.72              | 25             | Pass    |
| 20C 138V  | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| -20C 136V | a    | 5180               | Ant1    | 5179.96                     | -40000                  | -7.72              | 25             | Pass    |
| -10C 136V | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 0C 136V   | a    | 5180               | Ant1    | 5179.96                     | -40000                  | -7.72              | 25             | Pass    |
| 10C 136V  | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 20C 136V  | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 30C 136V  | a    | 5180               | Ant1    | 5180                        | 0                       | 0                  | 25             | Pass    |
| 40C 136V  | a    | 5180               | Ant1    | 5179.98                     | -20000                  | -3.86              | 25             | Pass    |
| 50C 136V  | a    | 5180               | Ant1    | 5179.96                     | -40000                  | -7.72              | 25             | Pass    |
| 20C 102V  | a    | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 20C 120V  | a    | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 20C 138V  | a    | 5200               | Ant1    | 5199.98                     | -20000                  | -3.85              | 25             | Pass    |
| -20C 120V | a    | 5200               | Ant1    | 5199.98                     | -20000                  | -3.85              | 25             | Pass    |
| -10C 120V | a    | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 0C 120V   | a    | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 10C 120V  | a    | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 30C 120V  | a    | 5200               | Ant1    | 5199.94                     | -60000                  | -11.54             | 25             | Pass    |
| 40C 120V  | a    | 5200               | Ant1    | 5199.96                     | -40000                  | -7.69              | 25             | Pass    |
| 50C 120V  | a    | 5200               | Ant1    | 5199.94                     | -60000                  | -11.54             | 25             | Pass    |
| 20C 102V  | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 20C 120V  | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| 20C 138V  | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| -20C 120V | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| -10C 120V | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| 0C 120V   | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 10C 120V  | a    | 5240               | Ant1    | 5239.98                     | -20000                  | -3.82              | 25             | Pass    |
| 30C 120V  | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| 40C 120V  | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| 50C 120V  | a    | 5240               | Ant1    | 5239.96                     | -40000                  | -7.63              | 25             | Pass    |
| 20C 102V  | a    | 5745               | Ant1    | 5744.96                     | -40000                  | -6.96              | 25             | Pass    |
| 20C 120V  | a    | 5745               | Ant1    | 5744.96                     | -40000                  | -6.96              | 25             | Pass    |
| 20C 138V  | a    | 5745               | Ant1    | 5745                        | 0                       | 0                  | 25             | Pass    |
| -20C 120V | a    | 5745               | Ant1    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |
| -10C 120V | a    | 5745               | Ant1    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |
| 0C 120V   | a    | 5745               | Ant1    | 5744.98                     | -20000                  | -3.48              | 25             | Pass    |

|           |     |      |      |         |        |        |    |      |
|-----------|-----|------|------|---------|--------|--------|----|------|
| 10C 120V  | a   | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 30C 120V  | a   | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 40C 120V  | a   | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 50C 120V  | a   | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 20C 102V  | a   | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 20C 120V  | a   | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 138V  | a   | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| -20C 120V | a   | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| -10C 120V | a   | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 0C 120V   | a   | 5785 | Ant1 | 5785    | 0      | 0      | 25 | Pass |
| 10C 120V  | a   | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 30C 120V  | a   | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 40C 120V  | a   | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 50C 120V  | a   | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 20C 102V  | a   | 5825 | Ant1 | 5825    | 0      | 0      | 25 | Pass |
| 20C 120V  | a   | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 20C 138V  | a   | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| -20C 120V | a   | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| -10C 120V | a   | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 0C 120V   | a   | 5825 | Ant1 | 5825    | 0      | 0      | 25 | Pass |
| 10C 120V  | a   | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 30C 120V  | a   | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 40C 120V  | a   | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 50C 120V  | a   | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 20C 102V  | n20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 20C 120V  | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 20C 138V  | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| -20C 120V | n20 | 5180 | Ant1 | 5180    | 0      | 0      | 25 | Pass |
| -10C 120V | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 0C 120V   | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 10C 120V  | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 30C 120V  | n20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 40C 120V  | n20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 50C 120V  | n20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 20C 102V  | n20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 20C 120V  | n20 | 5200 | Ant1 | 5199.94 | -60000 | -11.54 | 25 | Pass |
| 20C 138V  | n20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |
| -20C 120V | n20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| -10C 120V | n20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |
| 0C 120V   | n20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 10C 120V  | n20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |

|           |     |      |      |         |        |        |    |      |
|-----------|-----|------|------|---------|--------|--------|----|------|
| 30C 120V  | n20 | 5200 | Ant1 | 5199.94 | -60000 | -11.54 | 25 | Pass |
| 40C 120V  | n20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 50C 120V  | n20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 20C 102V  | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 20C 120V  | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 20C 138V  | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| -20C 120V | n20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| -10C 120V | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 0C 120V   | n20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| 10C 120V  | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 30C 120V  | n20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 40C 120V  | n20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| 50C 120V  | n20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| 20C 102V  | n20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 20C 120V  | n20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 20C 138V  | n20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| -20C 120V | n20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| -10C 120V | n20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 0C 120V   | n20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 10C 120V  | n20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 30C 120V  | n20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 40C 120V  | n20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 50C 120V  | n20 | 5745 | Ant1 | 5745    | 0      | 0      | 25 | Pass |
| 20C 102V  | n20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 120V  | n20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 138V  | n20 | 5785 | Ant1 | 5784.92 | -80000 | -13.83 | 25 | Pass |
| -20C 120V | n20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| -10C 120V | n20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 0C 120V   | n20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 10C 120V  | n20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 30C 120V  | n20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 40C 120V  | n20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 50C 120V  | n20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 102V  | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 20C 120V  | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 20C 138V  | n20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| -20C 120V | n20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| -10C 120V | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 0C 120V   | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 10C 120V  | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 30C 120V  | n20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |

|           |     |      |      |         |        |       |    |      |
|-----------|-----|------|------|---------|--------|-------|----|------|
| 40C 120V  | n20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43 | 25 | Pass |
| 50C 120V  | n20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3 | 25 | Pass |
| 20C 102V  | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 20C 120V  | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 20C 138V  | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| -20C 120V | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| -10C 120V | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 0C 120V   | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 10C 120V  | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 30C 120V  | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 40C 120V  | n40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71 | 25 | Pass |
| 50C 120V  | n40 | 5190 | Ant1 | 5190    | 0      | 0     | 25 | Pass |
| 20C 102V  | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 20C 120V  | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 20C 138V  | n40 | 5230 | Ant1 | 5229.92 | -80000 | -15.3 | 25 | Pass |
| -20C 120V | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| -10C 120V | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 0C 120V   | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 10C 120V  | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 30C 120V  | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 40C 120V  | n40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65 | 25 | Pass |
| 50C 120V  | n40 | 5230 | Ant1 | 5229.92 | -80000 | -15.3 | 25 | Pass |
| 20C 102V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 20C 120V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 20C 138V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| -20C 120V | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| -10C 120V | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 0C 120V   | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 10C 120V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 30C 120V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 40C 120V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 50C 120V  | n40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95 | 25 | Pass |
| 20C 102V  | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| 20C 120V  | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| 20C 138V  | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| -20C 120V | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| -10C 120V | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| 0C 120V   | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| 10C 120V  | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| 30C 120V  | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |
| 40C 120V  | n40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9  | 25 | Pass |

|           |      |      |      |         |        |        |    |      |
|-----------|------|------|------|---------|--------|--------|----|------|
| 50C 120V  | n40  | 5795 | Ant1 | 5794.96 | -40000 | -6.9   | 25 | Pass |
| 20C 102V  | ac20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 20C 120V  | ac20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 20C 138V  | ac20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| -20C 120V | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| -10C 120V | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 0C 120V   | ac20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 10C 120V  | ac20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 30C 120V  | ac20 | 5180 | Ant1 | 5179.98 | -20000 | -3.86  | 25 | Pass |
| 40C 120V  | ac20 | 5180 | Ant1 | 5179.94 | -60000 | -11.58 | 25 | Pass |
| 50C 120V  | ac20 | 5180 | Ant1 | 5179.96 | -40000 | -7.72  | 25 | Pass |
| 20C 102V  | ac20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 20C 120V  | ac20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |
| 20C 138V  | ac20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |
| -20C 120V | ac20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |
| -10C 120V | ac20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 0C 120V   | ac20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 10C 120V  | ac20 | 5200 | Ant1 | 5200    | 0      | 0      | 25 | Pass |
| 30C 120V  | ac20 | 5200 | Ant1 | 5199.98 | -20000 | -3.85  | 25 | Pass |
| 40C 120V  | ac20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 50C 120V  | ac20 | 5200 | Ant1 | 5199.96 | -40000 | -7.69  | 25 | Pass |
| 20C 102V  | ac20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| 20C 120V  | ac20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 20C 138V  | ac20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| -20C 120V | ac20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| -10C 120V | ac20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 0C 120V   | ac20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 10C 120V  | ac20 | 5240 | Ant1 | 5240    | 0      | 0      | 25 | Pass |
| 30C 120V  | ac20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 40C 120V  | ac20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| 50C 120V  | ac20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| 20C 102V  | ac20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 20C 120V  | ac20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 20C 138V  | ac20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| -20C 120V | ac20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| -10C 120V | ac20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 0C 120V   | ac20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 10C 120V  | ac20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 30C 120V  | ac20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 40C 120V  | ac20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 50C 120V  | ac20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |

|           |      |      |      |         |        |        |    |      |
|-----------|------|------|------|---------|--------|--------|----|------|
| 20C 102V  | ac20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 20C 120V  | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 138V  | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| -20C 120V | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| -10C 120V | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 0C 120V   | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 10C 120V  | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 30C 120V  | ac20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 40C 120V  | ac20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 50C 120V  | ac20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 20C 102V  | ac20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 20C 120V  | ac20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 20C 138V  | ac20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| -20C 120V | ac20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| -10C 120V | ac20 | 5825 | Ant1 | 5824.98 | -20000 | -3.43  | 25 | Pass |
| 0C 120V   | ac20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 10C 120V  | ac20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 30C 120V  | ac20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 40C 120V  | ac20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 50C 120V  | ac20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 20C 102V  | ac40 | 5190 | Ant1 | 5190    | 0      | 0      | 25 | Pass |
| 20C 120V  | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 20C 138V  | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| -20C 120V | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| -10C 120V | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 0C 120V   | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 10C 120V  | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 30C 120V  | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 40C 120V  | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 50C 120V  | ac40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 20C 102V  | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 20C 120V  | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 20C 138V  | ac40 | 5230 | Ant1 | 5230.04 | 40000  | 7.65   | 25 | Pass |
| -20C 120V | ac40 | 5230 | Ant1 | 5229.92 | -80000 | -15.3  | 25 | Pass |
| -10C 120V | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 0C 120V   | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 10C 120V  | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 30C 120V  | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 40C 120V  | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 50C 120V  | ac40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 20C 102V  | ac40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |


|           |      |      |      |         |         |        |    |      |
|-----------|------|------|------|---------|---------|--------|----|------|
| 20C 120V  | ac40 | 5755 | Ant1 | 5754.96 | -40000  | -6.95  | 25 | Pass |
| 20C 138V  | ac40 | 5755 | Ant1 | 5754.84 | -160000 | -27.8  | 25 | Pass |
| -20C 120V | ac40 | 5755 | Ant1 | 5754.88 | -120000 | -20.85 | 25 | Pass |
| -10C 120V | ac40 | 5755 | Ant1 | 5754.96 | -40000  | -6.95  | 25 | Pass |
| 0C 120V   | ac40 | 5755 | Ant1 | 5754.92 | -80000  | -13.9  | 25 | Pass |
| 10C 120V  | ac40 | 5755 | Ant1 | 5754.96 | -40000  | -6.95  | 25 | Pass |
| 30C 120V  | ac40 | 5755 | Ant1 | 5754.96 | -40000  | -6.95  | 25 | Pass |
| 40C 120V  | ac40 | 5755 | Ant1 | 5754.96 | -40000  | -6.95  | 25 | Pass |
| 50C 120V  | ac40 | 5755 | Ant1 | 5754.96 | -40000  | -6.95  | 25 | Pass |
| 20C 102V  | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 20C 120V  | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 20C 138V  | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| -20C 120V | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| -10C 120V | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 0C 120V   | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 10C 120V  | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 30C 120V  | ac40 | 5795 | Ant1 | 5795    | 0       | 0      | 25 | Pass |
| 40C 120V  | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 50C 120V  | ac40 | 5795 | Ant1 | 5794.96 | -40000  | -6.9   | 25 | Pass |
| 20C 102V  | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| 20C 120V  | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| 20C 138V  | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| -20C 120V | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| -10C 120V | ax20 | 5180 | Ant1 | 5179.94 | -60000  | -11.58 | 25 | Pass |
| 0C 120V   | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| 10C 120V  | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| 30C 120V  | ax20 | 5180 | Ant1 | 5179.94 | -60000  | -11.58 | 25 | Pass |
| 40C 120V  | ax20 | 5180 | Ant1 | 5179.96 | -40000  | -7.72  | 25 | Pass |
| 50C 120V  | ax20 | 5180 | Ant1 | 5179.98 | -20000  | -3.86  | 25 | Pass |
| 20C 102V  | ax20 | 5200 | Ant1 | 5199.98 | -20000  | -3.85  | 25 | Pass |
| 20C 120V  | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| 20C 138V  | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| -20C 120V | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| -10C 120V | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| 0C 120V   | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| 10C 120V  | ax20 | 5200 | Ant1 | 5199.98 | -20000  | -3.85  | 25 | Pass |
| 30C 120V  | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| 40C 120V  | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| 50C 120V  | ax20 | 5200 | Ant1 | 5199.96 | -40000  | -7.69  | 25 | Pass |
| 20C 102V  | ax20 | 5240 | Ant1 | 5239.96 | -40000  | -7.63  | 25 | Pass |
| 20C 120V  | ax20 | 5240 | Ant1 | 5239.96 | -40000  | -7.63  | 25 | Pass |


|           |      |      |      |         |        |        |    |      |
|-----------|------|------|------|---------|--------|--------|----|------|
| 20C 138V  | ax20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| -20C 120V | ax20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| -10C 120V | ax20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| 0C 120V   | ax20 | 5240 | Ant1 | 5239.98 | -20000 | -3.82  | 25 | Pass |
| 10C 120V  | ax20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 30C 120V  | ax20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 40C 120V  | ax20 | 5240 | Ant1 | 5239.94 | -60000 | -11.45 | 25 | Pass |
| 50C 120V  | ax20 | 5240 | Ant1 | 5239.96 | -40000 | -7.63  | 25 | Pass |
| 20C 102V  | ax20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 20C 120V  | ax20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 20C 138V  | ax20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| -20C 120V | ax20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| -10C 120V | ax20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 0C 120V   | ax20 | 5745 | Ant1 | 5744.94 | -60000 | -10.44 | 25 | Pass |
| 10C 120V  | ax20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 30C 120V  | ax20 | 5745 | Ant1 | 5744.96 | -40000 | -6.96  | 25 | Pass |
| 40C 120V  | ax20 | 5745 | Ant1 | 5744.98 | -20000 | -3.48  | 25 | Pass |
| 50C 120V  | ax20 | 5745 | Ant1 | 5744.92 | -80000 | -13.93 | 25 | Pass |
| 20C 102V  | ax20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 120V  | ax20 | 5785 | Ant1 | 5784.96 | -40000 | -6.91  | 25 | Pass |
| 20C 138V  | ax20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| -20C 120V | ax20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| -10C 120V | ax20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 0C 120V   | ax20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 10C 120V  | ax20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 30C 120V  | ax20 | 5785 | Ant1 | 5784.94 | -60000 | -10.37 | 25 | Pass |
| 40C 120V  | ax20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 50C 120V  | ax20 | 5785 | Ant1 | 5784.98 | -20000 | -3.46  | 25 | Pass |
| 20C 102V  | ax20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 20C 120V  | ax20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 20C 138V  | ax20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| -20C 120V | ax20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| -10C 120V | ax20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 0C 120V   | ax20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 10C 120V  | ax20 | 5825 | Ant1 | 5824.92 | -80000 | -13.73 | 25 | Pass |
| 30C 120V  | ax20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 40C 120V  | ax20 | 5825 | Ant1 | 5824.94 | -60000 | -10.3  | 25 | Pass |
| 50C 120V  | ax20 | 5825 | Ant1 | 5824.96 | -40000 | -6.87  | 25 | Pass |
| 20C 102V  | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 20C 120V  | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 20C 138V  | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |

|           |      |      |      |         |        |        |    |      |
|-----------|------|------|------|---------|--------|--------|----|------|
| -20C 120V | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| -10C 120V | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 0C 120V   | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 10C 120V  | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 30C 120V  | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 40C 120V  | ax40 | 5190 | Ant1 | 5189.92 | -80000 | -15.41 | 25 | Pass |
| 50C 120V  | ax40 | 5190 | Ant1 | 5189.96 | -40000 | -7.71  | 25 | Pass |
| 20C 102V  | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 20C 120V  | ax40 | 5230 | Ant1 | 5230    | 0      | 0      | 25 | Pass |
| 20C 138V  | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| -20C 120V | ax40 | 5230 | Ant1 | 5229.92 | -80000 | -15.3  | 25 | Pass |
| -10C 120V | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 0C 120V   | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 10C 120V  | ax40 | 5230 | Ant1 | 5229.92 | -80000 | -15.3  | 25 | Pass |
| 30C 120V  | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 40C 120V  | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 50C 120V  | ax40 | 5230 | Ant1 | 5229.96 | -40000 | -7.65  | 25 | Pass |
| 20C 102V  | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 20C 120V  | ax40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95  | 25 | Pass |
| 20C 138V  | ax40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95  | 25 | Pass |
| -20C 120V | ax40 | 5755 | Ant1 | 5754.96 | -40000 | -6.95  | 25 | Pass |
| -10C 120V | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 0C 120V   | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 10C 120V  | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 30C 120V  | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 40C 120V  | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 50C 120V  | ax40 | 5755 | Ant1 | 5754.92 | -80000 | -13.9  | 25 | Pass |
| 20C 102V  | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| 20C 120V  | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| 20C 138V  | ax40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9   | 25 | Pass |
| -20C 120V | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| -10C 120V | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| 0C 120V   | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| 10C 120V  | ax40 | 5795 | Ant1 | 5794.96 | -40000 | -6.9   | 25 | Pass |
| 30C 120V  | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| 40C 120V  | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |
| 50C 120V  | ax40 | 5795 | Ant1 | 5794.92 | -80000 | -13.81 | 25 | Pass |


## -6dB Bandwidth

| Condition | Mode | Frequency (MHz) | Antenna | -6 dB Bandwidth (MHz) | Limit -6 dB Bandwidth (MHz) | Verdict |
|-----------|------|-----------------|---------|-----------------------|-----------------------------|---------|
| NVNT      | a    | 5745            | Ant1    | 16.335                | 0.5                         | Pass    |
| NVNT      | a    | 5785            | Ant1    | 16.35                 | 0.5                         | Pass    |
| NVNT      | a    | 5825            | Ant1    | 16.338                | 0.5                         | Pass    |
| NVNT      | n20  | 5745            | Ant1    | 17.589                | 0.5                         | Pass    |
| NVNT      | n20  | 5785            | Ant1    | 17.592                | 0.5                         | Pass    |
| NVNT      | n20  | 5825            | Ant1    | 17.577                | 0.5                         | Pass    |
| NVNT      | n40  | 5755            | Ant1    | 36.312                | 0.5                         | Pass    |
| NVNT      | n40  | 5795            | Ant1    | 36.342                | 0.5                         | Pass    |
| NVNT      | ac20 | 5745            | Ant1    | 17.586                | 0.5                         | Pass    |
| NVNT      | ac20 | 5785            | Ant1    | 17.613                | 0.5                         | Pass    |
| NVNT      | ac20 | 5825            | Ant1    | 17.613                | 0.5                         | Pass    |
| NVNT      | ac40 | 5755            | Ant1    | 36.324                | 0.5                         | Pass    |
| NVNT      | ac40 | 5795            | Ant1    | 36.378                | 0.5                         | Pass    |
| NVNT      | ax20 | 5745            | Ant1    | 18.933                | 0.5                         | Pass    |
| NVNT      | ax20 | 5785            | Ant1    | 18.993                | 0.5                         | Pass    |
| NVNT      | ax20 | 5825            | Ant1    | 18.99                 | 0.5                         | Pass    |
| NVNT      | ax40 | 5755            | Ant1    | 37.806                | 0.5                         | Pass    |
| NVNT      | ax40 | 5795            | Ant1    | 38.022                | 0.5                         | Pass    |

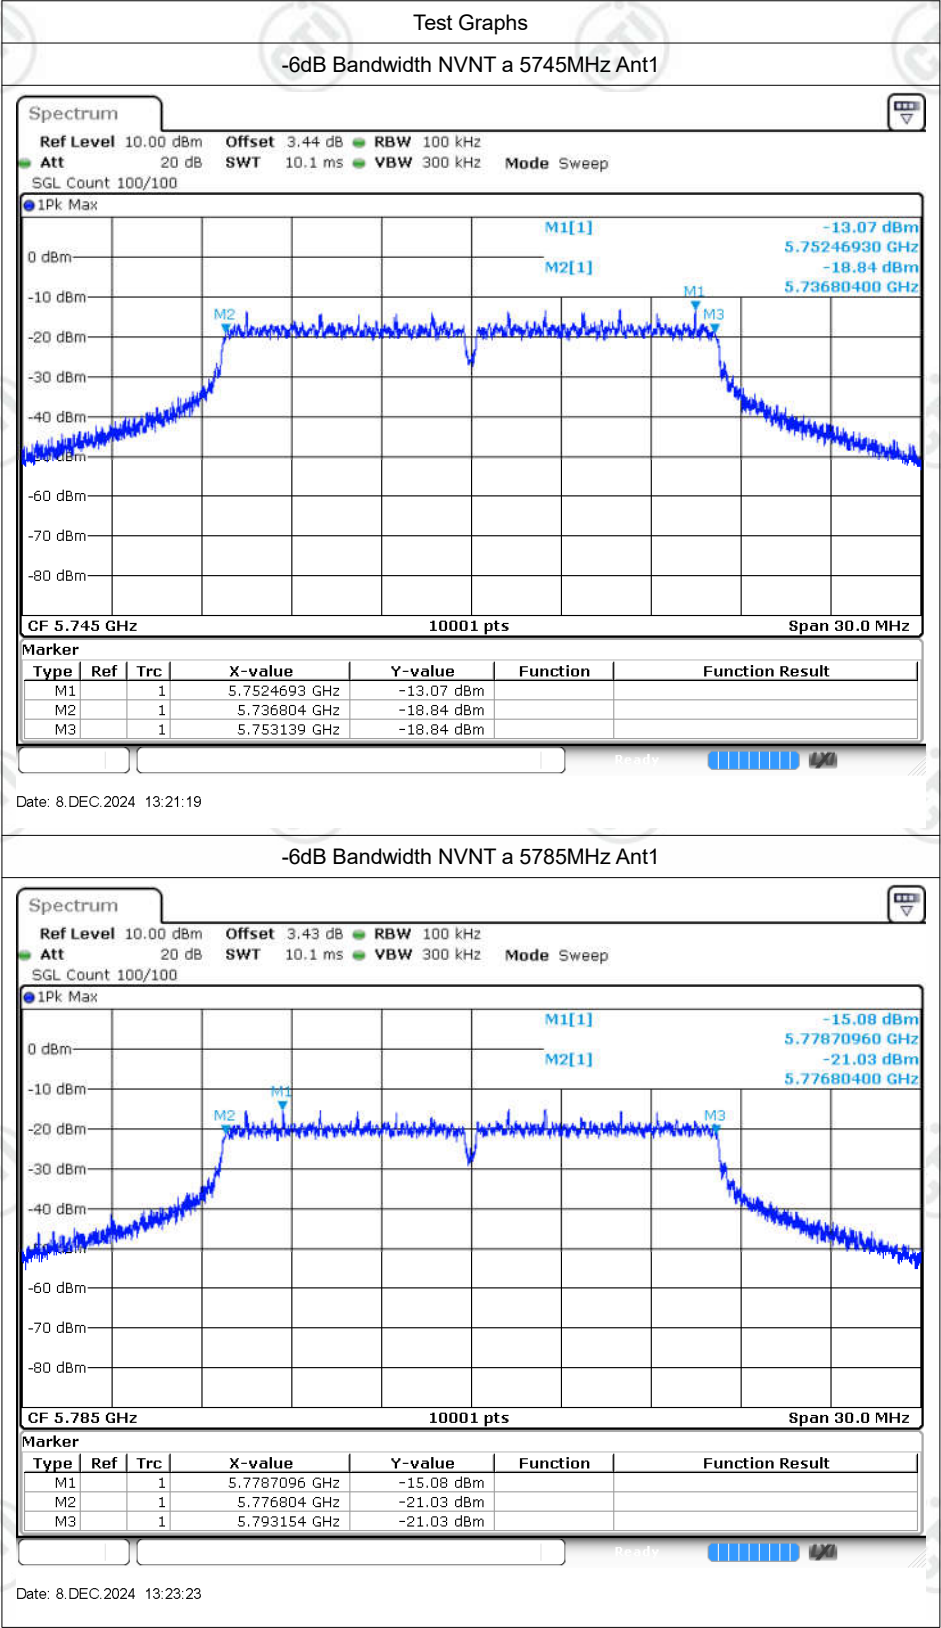


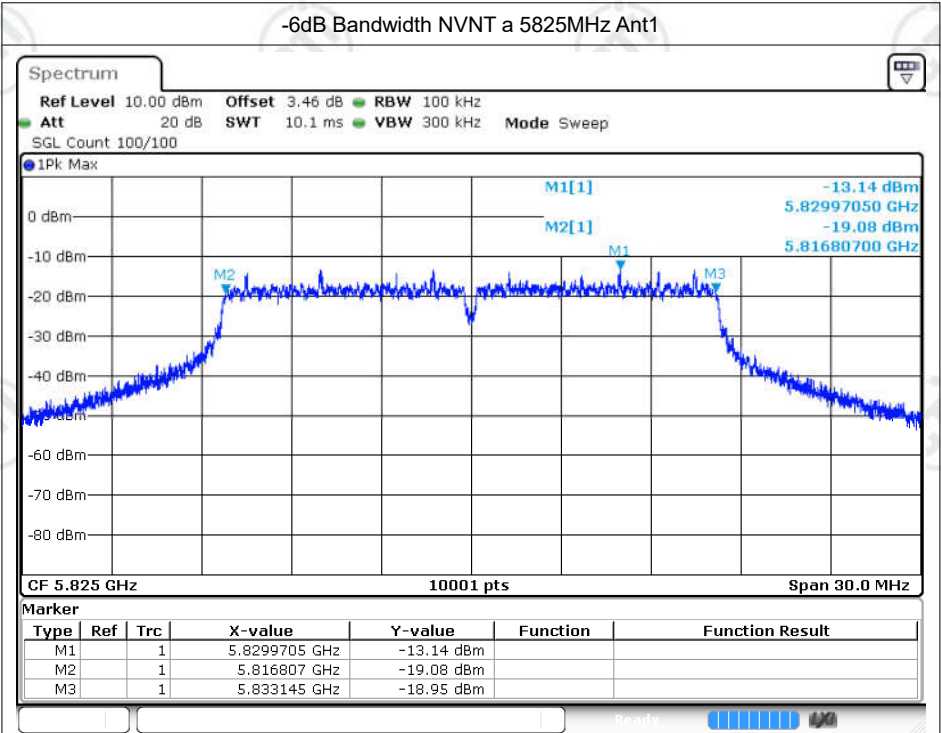


Date: 8.DEC.2024 13:25:55

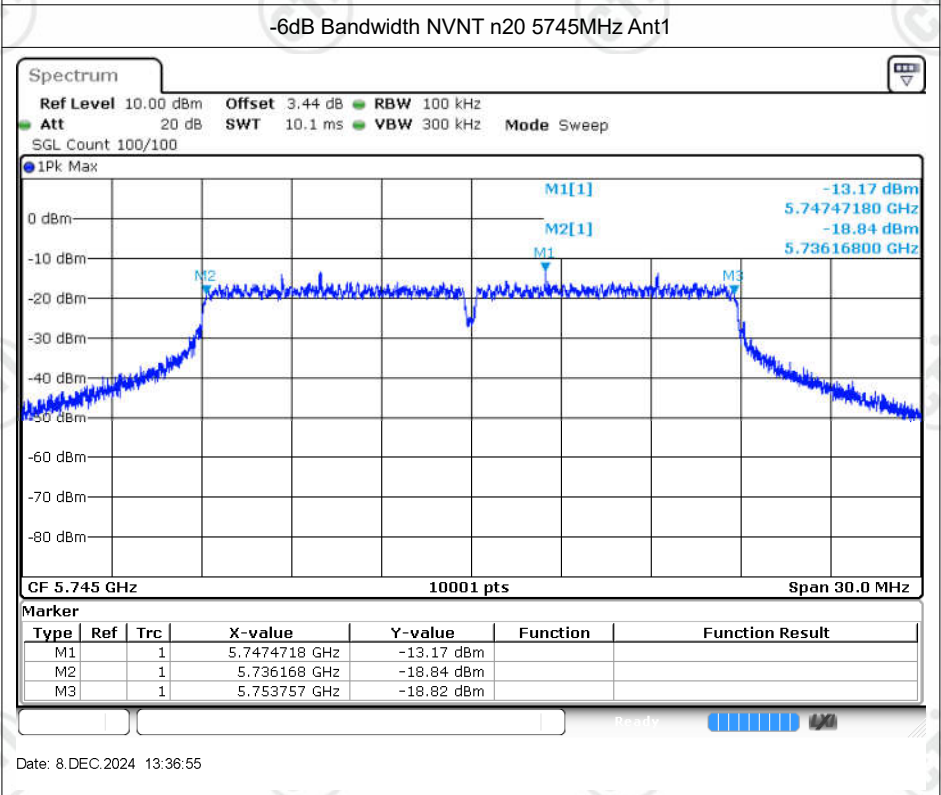


Date: 8.DEC.2024 13:36:55

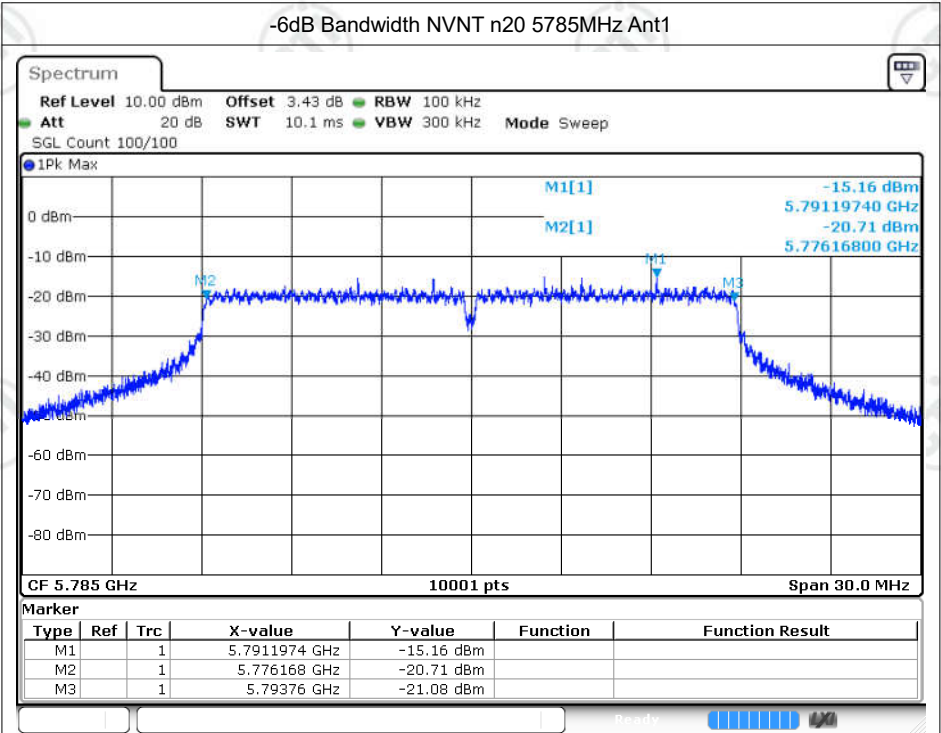


Date: 8.DEC.2024 13:38:41

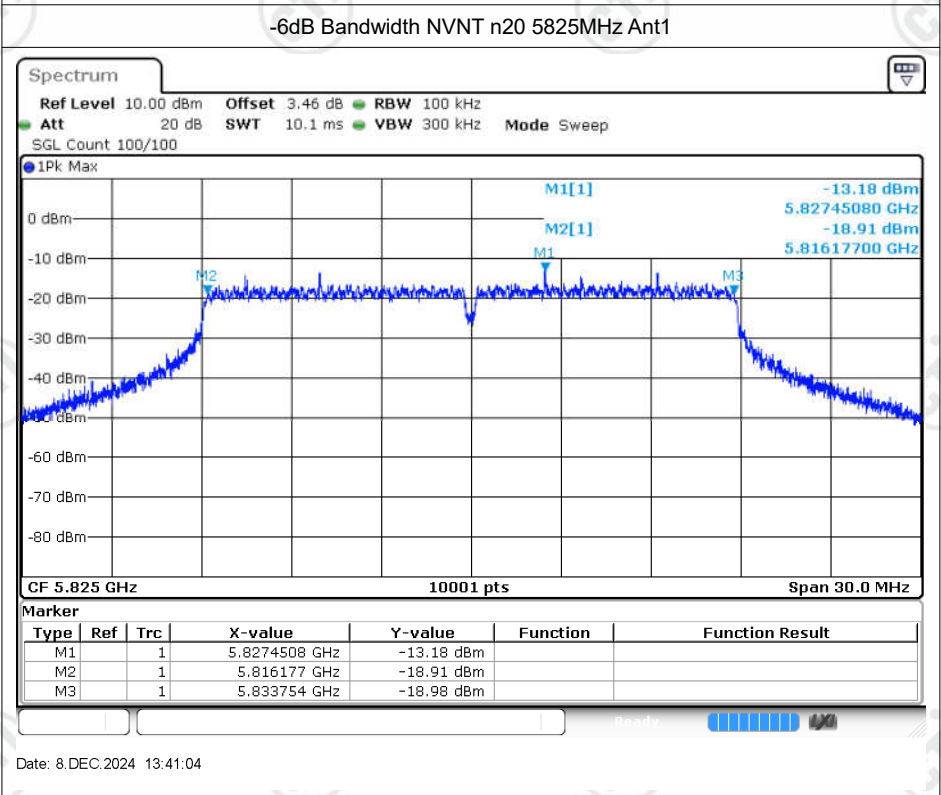


Date: 8.DEC.2024 13:41:04

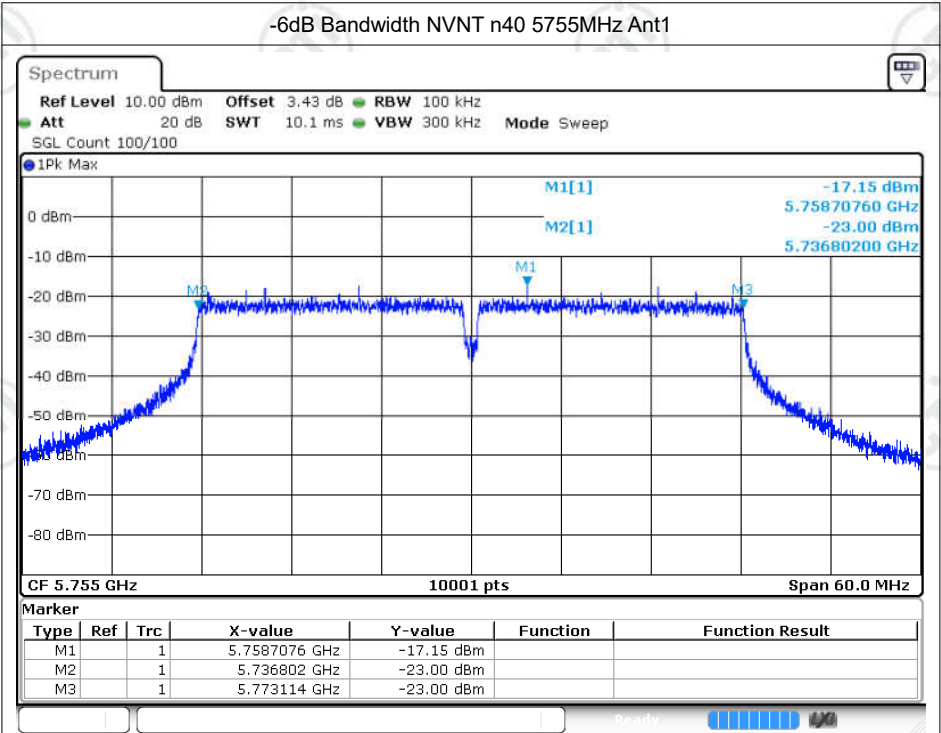


Date: 8.DEC.2024 13:47:19

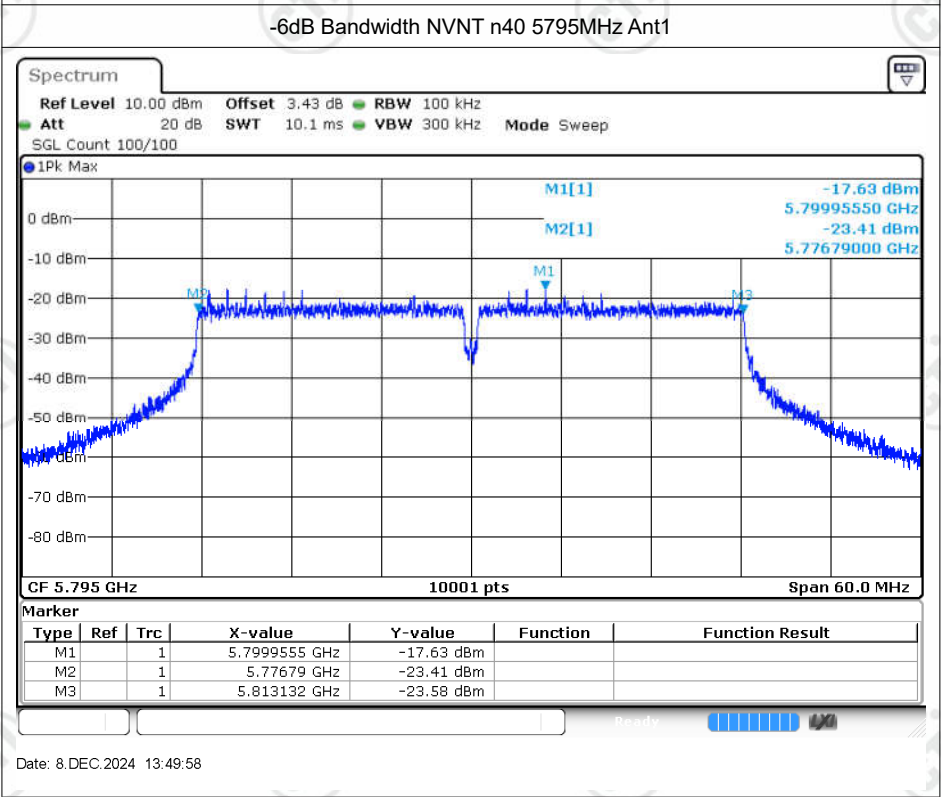


Date: 8.DEC.2024 13:49:58

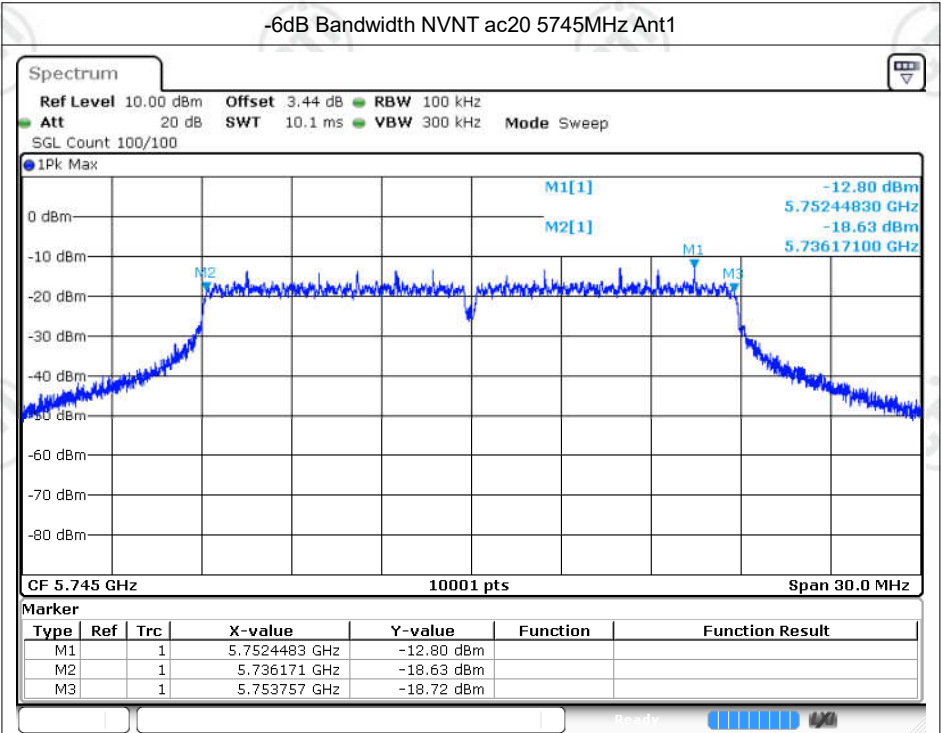


Date: 8.DEC.2024 13:59:44

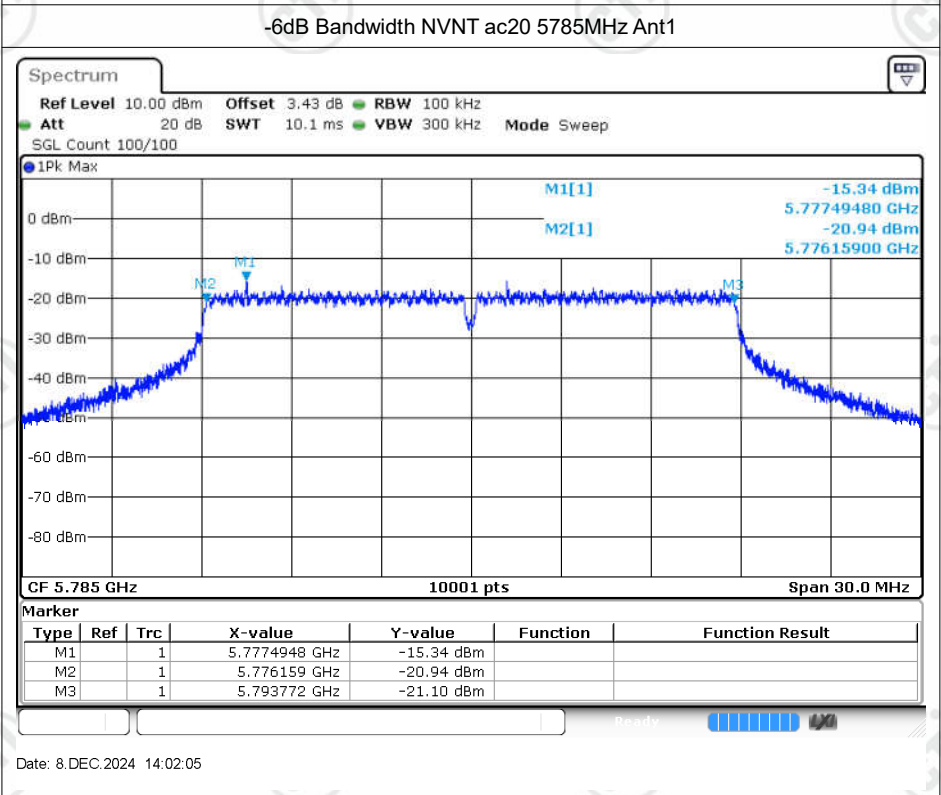


Date: 8.DEC.2024 14:02:05

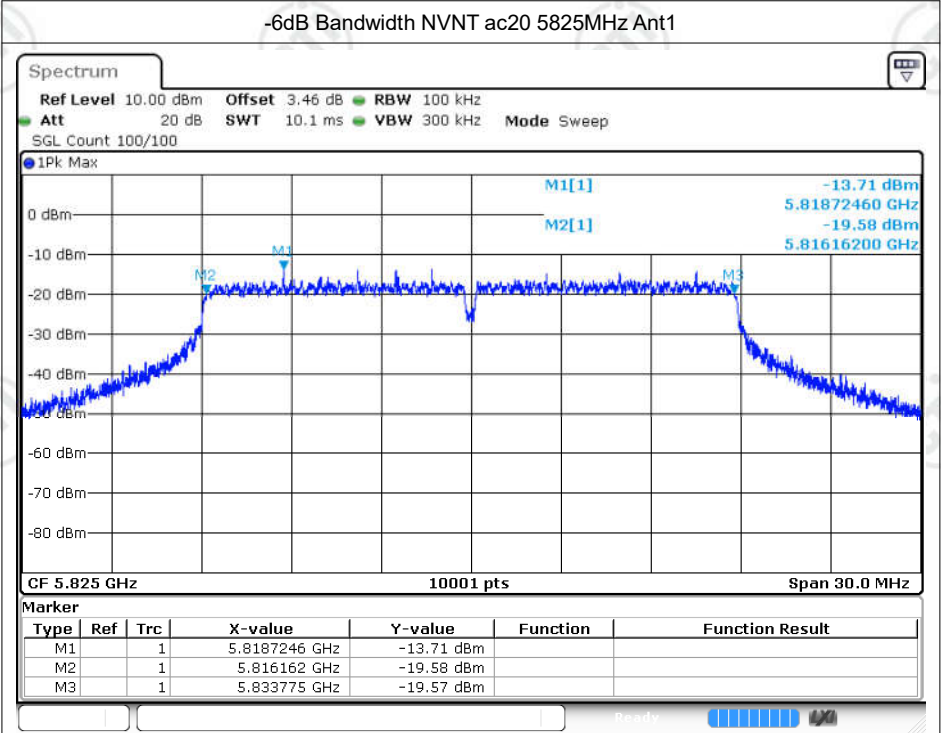


Date: 8.DEC.2024 14:04:04

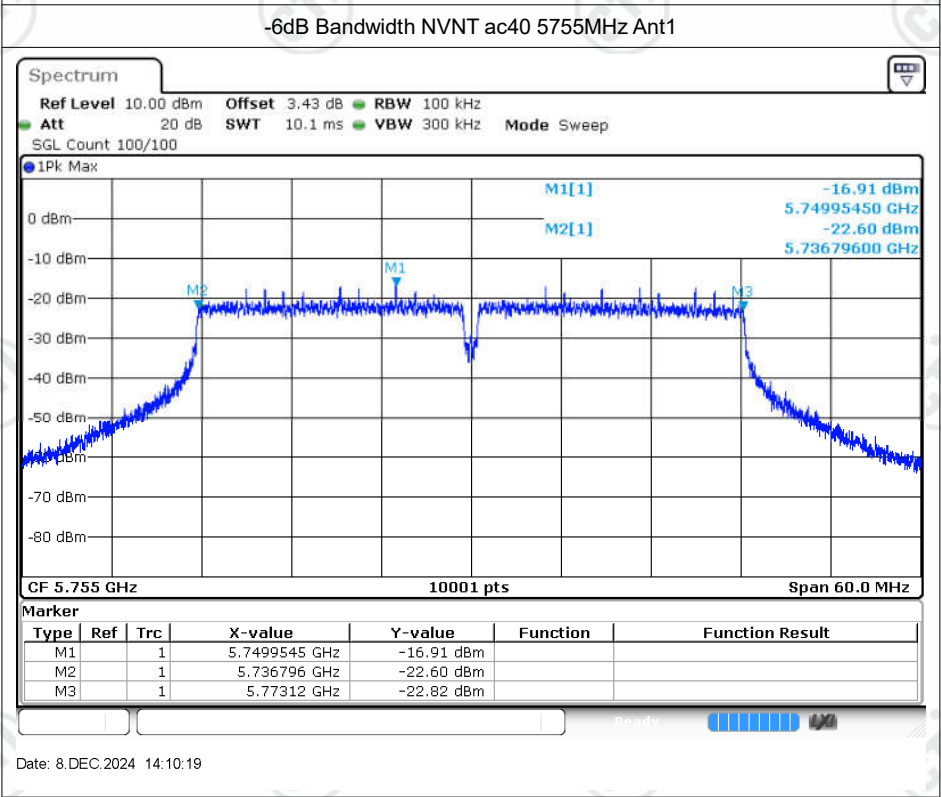


Date: 8.DEC.2024 14:10:19

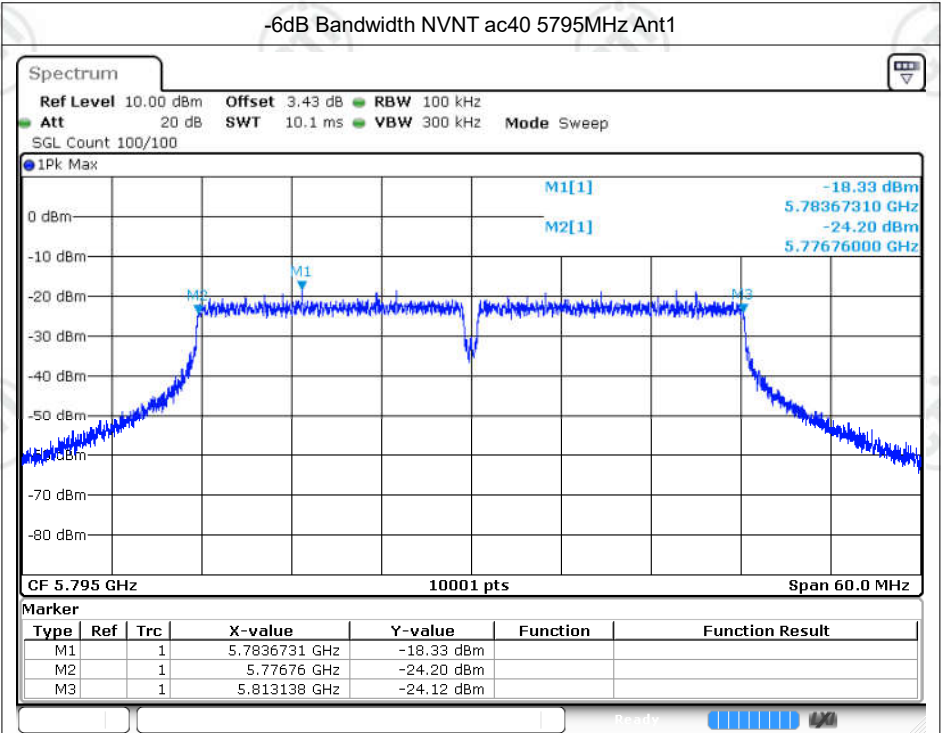


Date: 8.DEC.2024 14:12:19

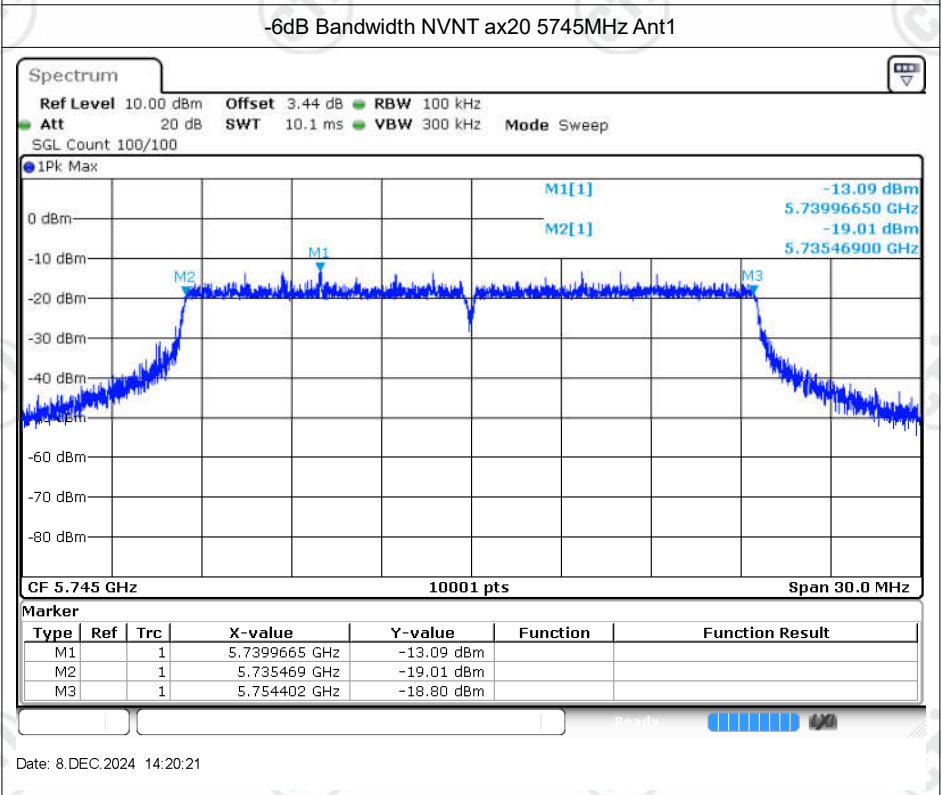


Date: 8.DEC.2024 14:20:21

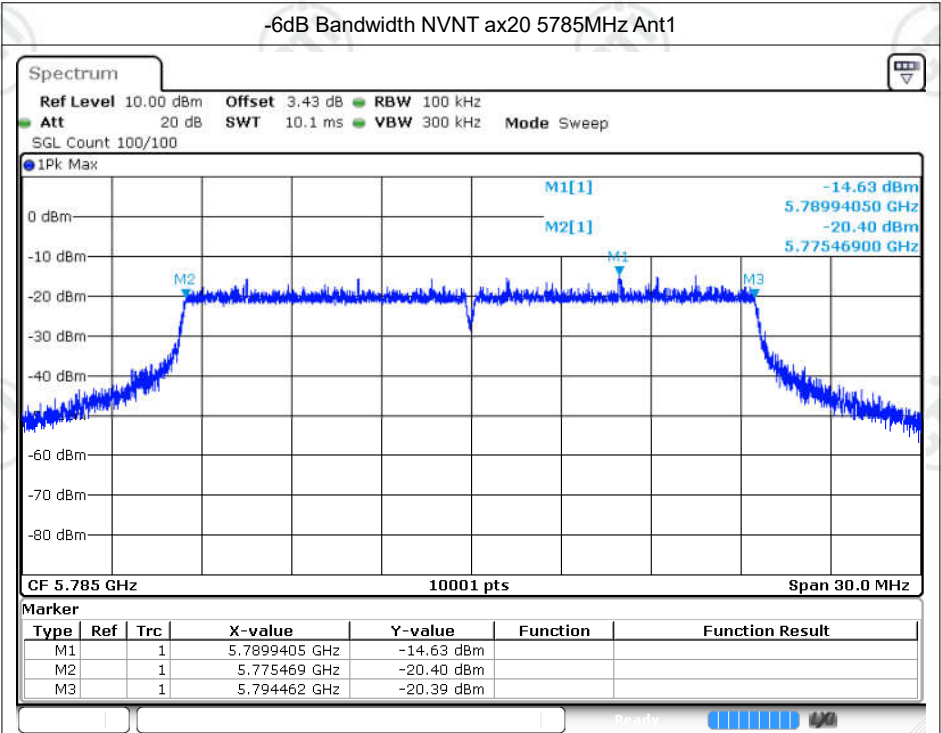


Date: 8.DEC.2024 14:22:17

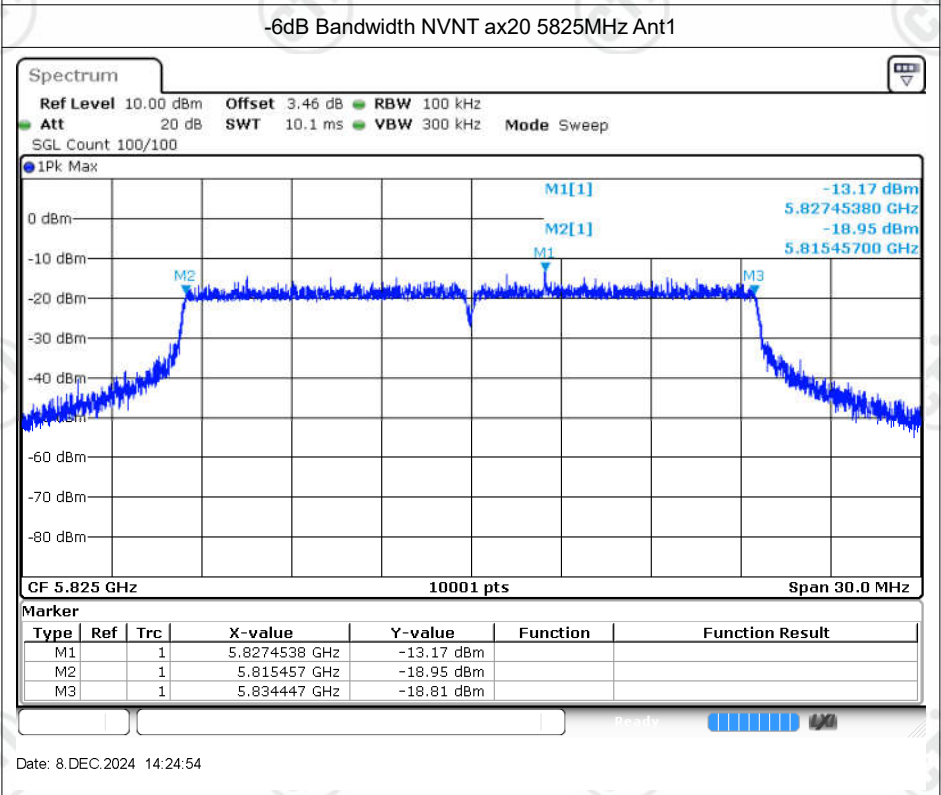

Date: 8.DEC.2024 14:24:54

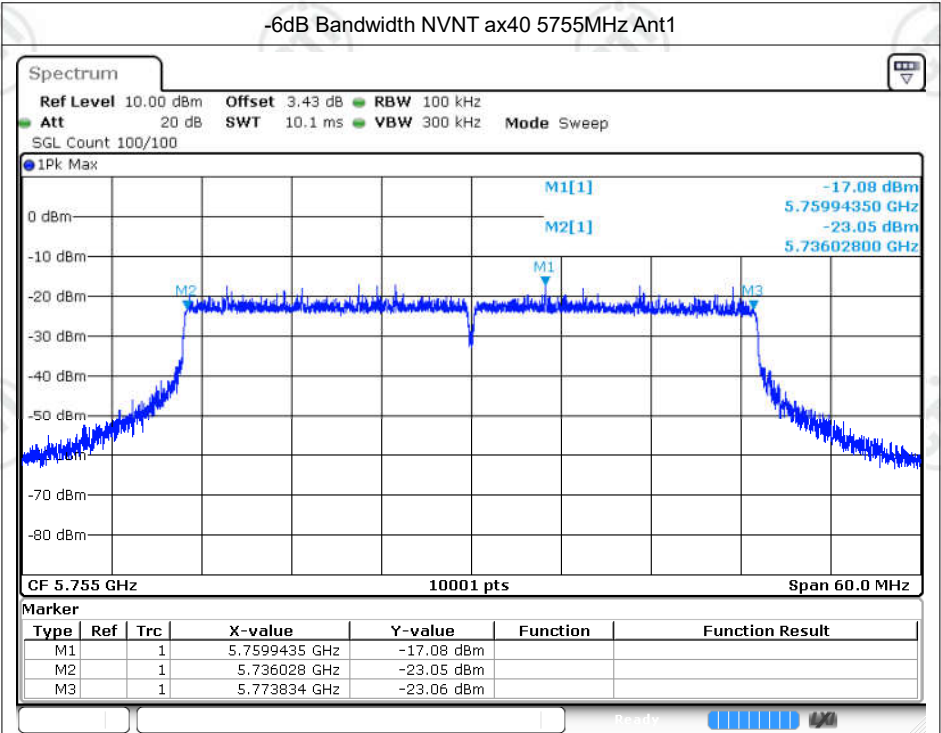

Date: 8.DEC.2024 14:30:23

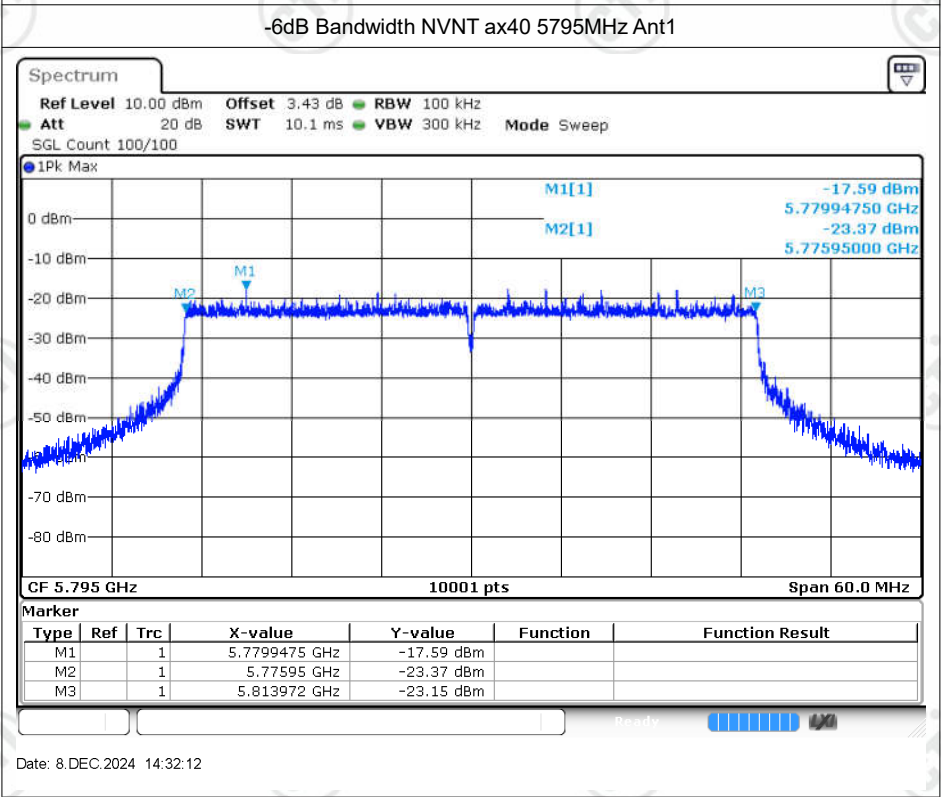

Date: 8.DEC.2024 14:32:12

\*\*\*END OF REPORT\*\*\*