



Band Edge NVNT n20 5825MHz High Ant1



Band Edge NVNT n40 5755MHz Low Ant1



Band Edge NVNT n40 5795MHz High Ant1





Band Edge NVNT n40 5755MHz Low Ant2



Band Edge NVNT n40 5795MHz High Ant2



Band Edge NVNT ac20 5745MHz Low Ant1





Band Edge NVNT ac20 5825MHz High Ant1



Band Edge NVNT ac40 5755MHz Low Ant1



Band Edge NVNT ac40 5795MHz High Ant1





Band Edge NVNT ac40 5755MHz Low Ant2




Band Edge NVNT ac40 5795MHz High Ant2



Band Edge NVNT ac80 5775MHz Low Ant1



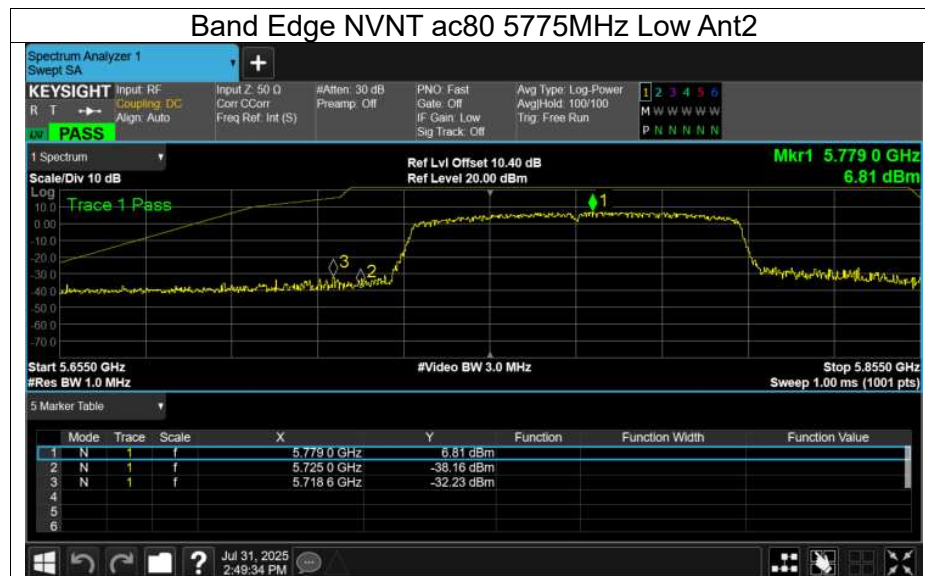



Restrict Band

Condi- tion	Mode	Frequ- ency (MHz)	Anten- na	Spur Freq (MHz)	Powe- r (dBm)	Gain (dBi)	E (dBuV /m)	Detector	Limit (dBuV /m)	Verdi- ct
NVNT	a	5180	Ant1	4500	-40.77	5.3	59.76	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-50.55	5.3	49.98	Average	54	Pass
NVNT	a	5180	Ant1	5034.1	-36.17	5.3	64.36	Peak	68.2	Pass
NVNT	a	5180	Ant1	5148.9	-47.64	5.3	52.89	Average	54	Pass
NVNT	a	5180	Ant1	5150	-38.68	5.3	61.85	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-47.74	5.3	52.79	Average	54	Pass
NVNT	a	5240	Ant1	5350	-40.79	5.3	59.74	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-50.41	5.3	50.12	Average	54	Pass
NVNT	a	5240	Ant1	5392.08	-37.88	5.3	62.65	Peak	68.2	Pass
NVNT	a	5240	Ant1	5387.52	-50.16	5.3	50.37	Average	54	Pass
NVNT	a	5240	Ant1	5460	-41.24	5.3	59.29	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-50.64	5.3	49.89	Average	54	Pass
NVNT	a	5260	Ant1	4500	-40.82	5.3	59.71	Peak	68.2	Pass
NVNT	a	5260	Ant1	4500	-50.57	5.3	49.96	Average	54	Pass
NVNT	a	5260	Ant1	5141.16	-34.88	5.3	65.65	Peak	68.2	Pass
NVNT	a	5260	Ant1	5113.08	-48.46	5.3	52.07	Average	54	Pass
NVNT	a	5260	Ant1	5150	-39.84	5.3	60.69	Peak	68.2	Pass
NVNT	a	5260	Ant1	5150	-48.92	5.3	51.61	Average	54	Pass
NVNT	a	5320	Ant1	5350	-38.8	5.3	61.73	Peak	68.2	Pass
NVNT	a	5320	Ant1	5350	-49.38	5.3	51.15	Average	54	Pass
NVNT	a	5320	Ant1	5399.6	-37.46	5.3	63.07	Peak	68.2	Pass
NVNT	a	5320	Ant1	5400.4	-48.82	5.3	51.71	Average	54	Pass
NVNT	a	5320	Ant1	5460	-39.56	5.3	60.97	Peak	68.2	Pass
NVNT	a	5320	Ant1	5460	-50.19	5.3	50.34	Average	54	Pass
NVNT	a	5500	Ant1	5460	-40.02	5.3	60.51	Peak	68.2	Pass
NVNT	a	5500	Ant1	5460	-49.52	5.3	51.01	Average	54	Pass
NVNT	a	5500	Ant1	5466.6	-35.44	5.3	65.09	Peak	68.2	Pass
NVNT	a	5500	Ant1	5466.6	-48.85	5.3	51.68	Average	54	Pass
NVNT	a	5500	Ant1	5470	-40.69	5.3	59.84	Peak	68.2	Pass
NVNT	a	5500	Ant1	5470	-48.91	5.3	51.62	Average	54	Pass
NVNT	a	5700	Ant1	5725	-36.76	5.3	63.77	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725	-47.25	5.3	53.28	Average	54	Pass
NVNT	a	5700	Ant1	5726.2	-35.7	5.3	64.83	Peak	68.2	Pass
NVNT	a	5700	Ant1	5725.8	-47.2	5.3	53.33	Average	54	Pass
NVNT	a	5700	Ant1	5735	-38.63	5.3	61.9	Peak	68.2	Pass
NVNT	a	5700	Ant1	5735	-48.43	5.3	52.1	Average	54	Pass
NVNT	a	5745	Ant1	5650	-37.97	5.3	-32.67	Peak	-27	Pass
NVNT	a	5745	Ant1	5650	-49.77	5.3	-44.47	Average	-27	Pass
NVNT	a	5745	Ant1	5700	-35.37	5.3	-30.07	Peak	10	Pass
NVNT	a	5745	Ant1	5700	-47.74	5.3	-42.44	Average	10	Pass
NVNT	a	5745	Ant1	5720	-26.46	5.3	-21.16	Peak	15.6	Pass
NVNT	a	5745	Ant1	5720	-43.78	5.3	-38.48	Average	15.6	Pass
NVNT	a	5745	Ant1	5725	-21.22	5.3	-15.92	Peak	27	Pass
NVNT	a	5745	Ant1	5725	-39.12	5.3	-33.82	Average	27	Pass
NVNT	a	5825	Ant1	5850	-25.99	5.3	-20.69	Peak	27	Pass
NVNT	a	5825	Ant1	5850	-42.68	5.3	-37.38	Average	27	Pass
NVNT	a	5825	Ant1	5855	-31.85	5.3	-26.55	Peak	15.6	Pass
NVNT	a	5825	Ant1	5855	-45.65	5.3	-40.35	Average	15.6	Pass
NVNT	a	5825	Ant1	5875	-39.86	5.3	-34.56	Peak	10	Pass
NVNT	a	5825	Ant1	5875	-48.33	5.3	-43.03	Average	10	Pass
NVNT	a	5825	Ant1	5925	-38.83	5.3	-33.53	Peak	-27	Pass



NVNT	a	5825	Ant1	5925	-48.87	5.3	-43.57	Average	-27	Pass
NVNT	a	5180	Ant2	4500	-40.35	5.3	60.18	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-50.3	5.3	50.23	Average	54	Pass
NVNT	a	5180	Ant2	4610.6	-36.51	5.3	64.02	Peak	68.2	Pass
NVNT	a	5180	Ant2	5102	-48.25	5.3	52.28	Average	54	Pass
NVNT	a	5180	Ant2	5150	-39.04	5.3	61.49	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-48.72	5.3	51.81	Average	54	Pass
NVNT	a	5240	Ant2	5350	-39.79	5.3	60.74	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-50.51	5.3	50.02	Average	54	Pass
NVNT	a	5240	Ant2	5406.24	-38.2	5.3	62.33	Peak	68.2	Pass
NVNT	a	5240	Ant2	5418.72	-50.15	5.3	50.38	Average	54	Pass
NVNT	a	5240	Ant2	5460	-39.83	5.3	60.7	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-50.19	5.3	50.34	Average	54	Pass
NVNT	a	5260	Ant2	4500	-41.13	5.3	59.4	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-50.07	5.3	50.46	Average	54	Pass
NVNT	a	5260	Ant2	5109.18	-35.79	5.3	64.74	Peak	68.2	Pass
NVNT	a	5260	Ant2	4695	-48.32	5.3	52.21	Average	54	Pass
NVNT	a	5260	Ant2	5150	-39.02	5.3	61.51	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-49.02	5.3	51.51	Average	54	Pass
NVNT	a	5320	Ant2	5350	-40.38	5.3	60.15	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-49.7	5.3	50.83	Average	54	Pass
NVNT	a	5320	Ant2	5350.4	-36.6	5.3	63.93	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350.4	-49.56	5.3	50.97	Average	54	Pass
NVNT	a	5320	Ant2	5460	-41.39	5.3	59.14	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-50.02	5.3	50.51	Average	54	Pass
NVNT	a	5500	Ant2	5460	-39.41	5.3	61.12	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-49.4	5.3	51.13	Average	54	Pass
NVNT	a	5500	Ant2	5466.8	-37.68	5.3	62.85	Peak	68.2	Pass
NVNT	a	5500	Ant2	5469.6	-48.89	5.3	51.64	Average	54	Pass
NVNT	a	5500	Ant2	5470	-39.08	5.3	61.45	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-48.91	5.3	51.62	Average	54	Pass
NVNT	a	5700	Ant2	5725	-39.64	5.3	60.89	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-48.8	5.3	51.73	Average	54	Pass
NVNT	a	5700	Ant2	5728.6	-36.72	5.3	63.81	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-40.05	5.3	60.48	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-49.37	5.3	51.16	Average	54	Pass
NVNT	a	5745	Ant2	5650	-39.4	5.3	-34.1	Peak	-27	Pass
NVNT	a	5745	Ant2	5650	-49.61	5.3	-44.31	Average	-27	Pass
NVNT	a	5745	Ant2	5700	-39.85	5.3	-34.55	Peak	10	Pass
NVNT	a	5745	Ant2	5700	-49.27	5.3	-43.97	Average	10	Pass
NVNT	a	5745	Ant2	5720	-26.5	5.3	-21.2	Peak	15.6	Pass
NVNT	a	5745	Ant2	5720	-47.13	5.3	-41.83	Average	15.6	Pass
NVNT	a	5745	Ant2	5725	-25.9	5.3	-20.6	Peak	27	Pass
NVNT	a	5745	Ant2	5725	-44.67	5.3	-39.37	Average	27	Pass
NVNT	a	5825	Ant2	5850	-23.67	5.3	-18.37	Peak	27	Pass
NVNT	a	5825	Ant2	5850	-40.99	5.3	-35.69	Average	27	Pass
NVNT	a	5825	Ant2	5855	-28.44	5.3	-23.14	Peak	15.6	Pass
NVNT	a	5825	Ant2	5855	-44.41	5.3	-39.11	Average	15.6	Pass
NVNT	a	5825	Ant2	5875	-38.62	5.3	-33.32	Peak	10	Pass
NVNT	a	5825	Ant2	5875	-48.78	5.3	-43.48	Average	10	Pass
NVNT	a	5825	Ant2	5925	-40.69	5.3	-35.39	Peak	-27	Pass
NVNT	a	5825	Ant2	5925	-49.05	5.3	-43.75	Average	-27	Pass
NVNT	n20	5180	Ant1	4500	-40.78	5.3	59.75	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-50.67	5.3	49.86	Average	54	Pass
NVNT	n20	5180	Ant1	4696	-36.92	5.3	63.61	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5096.4	-48.46	5.3	52.07	Average	54	Pass



NVNT	n20	5180	Ant1	5150	-40.98	5.3	59.55	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-48.87	5.3	51.66	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-41.73	5.3	58.8	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-51.19	5.3	49.34	Average	54	Pass
NVNT	n20	5240	Ant1	5410.56	-38.61	5.3	61.92	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5408.16	-50.57	5.3	49.96	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-41.26	5.3	59.27	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-50.84	5.3	49.69	Average	54	Pass
NVNT	n20	5260	Ant1	4500	-40.7	5.3	59.83	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4500	-50.65	5.3	49.88	Average	54	Pass
NVNT	n20	5260	Ant1	4521.06	-36.43	5.3	64.1	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4694.22	-48.71	5.3	51.82	Average	54	Pass
NVNT	n20	5260	Ant1	5150	-37.57	5.3	62.96	Peak	68.2	Pass
NVNT	n20	5260	Ant1	5150	-49.32	5.3	51.21	Average	54	Pass
NVNT	n20	5320	Ant1	5350	-39.86	5.3	60.67	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5350	-50.39	5.3	50.14	Average	54	Pass
NVNT	n20	5320	Ant1	5454.2	-37.95	5.3	62.58	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5398.4	-49.34	5.3	51.19	Average	54	Pass
NVNT	n20	5320	Ant1	5460	-40.98	5.3	59.55	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5460	-50.76	5.3	49.77	Average	54	Pass
NVNT	n20	5500	Ant1	5460	-40.88	5.3	59.65	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5460	-50.28	5.3	50.25	Average	54	Pass
NVNT	n20	5500	Ant1	5467.6	-37.55	5.3	62.98	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5469.4	-49.84	5.3	50.69	Average	54	Pass
NVNT	n20	5500	Ant1	5470	-40.81	5.3	59.72	Peak	68.2	Pass
NVNT	n20	5500	Ant1	5470	-49.89	5.3	50.64	Average	54	Pass
NVNT	n20	5700	Ant1	5725	-36.49	5.3	64.04	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5725	-46.92	5.3	53.61	Average	54	Pass
NVNT	n20	5700	Ant1	5725.2	-34.89	5.3	65.64	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-39.63	5.3	60.9	Peak	68.2	Pass
NVNT	n20	5700	Ant1	5735	-49.41	5.3	51.12	Average	54	Pass
NVNT	n20	5745	Ant1	5650	-40.88	5.3	-35.58	Peak	-27	Pass
NVNT	n20	5745	Ant1	5650	-50.1	5.3	-44.8	Average	-27	Pass
NVNT	n20	5745	Ant1	5700	-37.67	5.3	-32.37	Peak	10	Pass
NVNT	n20	5745	Ant1	5700	-49.16	5.3	-43.86	Average	10	Pass
NVNT	n20	5745	Ant1	5720	-31.71	5.3	-26.41	Peak	15.6	Pass
NVNT	n20	5745	Ant1	5720	-46.24	5.3	-40.94	Average	15.6	Pass
NVNT	n20	5745	Ant1	5725	-21.85	5.3	-16.55	Peak	27	Pass
NVNT	n20	5745	Ant1	5725	-42.63	5.3	-37.33	Average	27	Pass
NVNT	n20	5825	Ant1	5850	-23.6	5.3	-18.3	Peak	27	Pass
NVNT	n20	5825	Ant1	5850	-42.27	5.3	-36.97	Average	27	Pass
NVNT	n20	5825	Ant1	5855	-33.69	5.3	-28.39	Peak	15.6	Pass
NVNT	n20	5825	Ant1	5855	-46.62	5.3	-41.32	Average	15.6	Pass
NVNT	n20	5825	Ant1	5875	-39.73	5.3	-34.43	Peak	10	Pass
NVNT	n20	5825	Ant1	5875	-49.58	5.3	-44.28	Average	10	Pass
NVNT	n20	5825	Ant1	5925	-40.61	5.3	-35.31	Peak	-27	Pass
NVNT	n20	5825	Ant1	5925	-49.77	5.3	-44.47	Average	-27	Pass
NVNT	n20	5180	Ant2	4500	-40.76	5.3	59.77	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-50.24	5.3	50.29	Average	54	Pass
NVNT	n20	5180	Ant2	5090.8	-36.31	5.3	64.22	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4690.4	-48.3	5.3	52.23	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-39.26	5.3	61.27	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-48.87	5.3	51.66	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-41.77	5.3	58.76	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-50.81	5.3	49.72	Average	54	Pass
NVNT	n20	5240	Ant2	5457.6	-37.72	5.3	62.81	Peak	68.2	Pass



NVNT	n20	5240	Ant2	5450.64	-50.27	5.3	50.26	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-39.61	5.3	60.92	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-50.45	5.3	50.08	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-40.49	5.3	60.04	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-50.09	5.3	50.44	Average	54	Pass
NVNT	n20	5260	Ant2	4691.1	-36.01	5.3	64.52	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4687.98	-48.02	5.3	52.51	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-39.1	5.3	61.43	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-48.82	5.3	51.71	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-41.49	5.3	59.04	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-50.1	5.3	50.43	Average	54	Pass
NVNT	n20	5320	Ant2	5448	-38.96	5.3	61.57	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5399.2	-49.93	5.3	50.6	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-39.43	5.3	61.1	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-50.31	5.3	50.22	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-40.95	5.3	59.58	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-50.05	5.3	50.48	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-38.61	5.3	61.92	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5469.6	-49.46	5.3	51.07	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-49.58	5.3	50.95	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-39.28	5.3	61.25	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-48.85	5.3	51.68	Average	54	Pass
NVNT	n20	5700	Ant2	5727.6	-37.53	5.3	63	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-39.67	5.3	60.86	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-49.76	5.3	50.77	Average	54	Pass
NVNT	n20	5745	Ant2	5650	-40.7	5.3	-35.4	Peak	-27	Pass
NVNT	n20	5745	Ant2	5650	-49.77	5.3	-44.47	Average	-27	Pass
NVNT	n20	5745	Ant2	5700	-39.04	5.3	-33.74	Peak	10	Pass
NVNT	n20	5745	Ant2	5700	-49.64	5.3	-44.34	Average	10	Pass
NVNT	n20	5745	Ant2	5720	-36.06	5.3	-30.76	Peak	15.6	Pass
NVNT	n20	5745	Ant2	5720	-48.75	5.3	-43.45	Average	15.6	Pass
NVNT	n20	5745	Ant2	5725	-34.13	5.3	-28.83	Peak	27	Pass
NVNT	n20	5745	Ant2	5725	-46.41	5.3	-41.11	Average	27	Pass
NVNT	n20	5825	Ant2	5850	-20.18	5.3	-14.88	Peak	27	Pass
NVNT	n20	5825	Ant2	5850	-41.11	5.3	-35.81	Average	27	Pass
NVNT	n20	5825	Ant2	5855	-28.26	5.3	-22.96	Peak	15.6	Pass
NVNT	n20	5825	Ant2	5855	-44.29	5.3	-38.99	Average	15.6	Pass
NVNT	n20	5825	Ant2	5875	-38.4	5.3	-33.1	Peak	10	Pass
NVNT	n20	5825	Ant2	5875	-49.07	5.3	-43.77	Average	10	Pass
NVNT	n20	5825	Ant2	5925	-40.03	5.3	-34.73	Peak	-27	Pass
NVNT	n20	5825	Ant2	5925	-49.48	5.3	-44.18	Average	-27	Pass
NVNT	n40	5190	Ant1	4500	-41.58	5.3	58.95	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-50.46	5.3	50.07	Average	54	Pass
NVNT	n40	5190	Ant1	4659.14	-36.99	5.3	63.54	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-47.16	5.3	53.37	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-38.13	5.3	62.4	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-47.09	5.3	53.44	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-43.05	5.3	57.48	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-50.79	5.3	49.74	Average	54	Pass
NVNT	n40	5230	Ant1	5450.82	-39.02	5.3	61.51	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5447.31	-50.26	5.3	50.27	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-41.39	5.3	59.14	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-50.53	5.3	50	Average	54	Pass
NVNT	n40	5270	Ant1	4500	-41.15	5.3	59.38	Peak	68.2	Pass
NVNT	n40	5270	Ant1	4500	-50.26	5.3	50.27	Average	54	Pass
NVNT	n40	5270	Ant1	4698.45	-36.45	5.3	64.08	Peak	68.2	Pass



NVNT	n40	5270	Ant1	4691.97	-48.31	5.3	52.22	Average	54	Pass
NVNT	n40	5270	Ant1	5150	-40.26	5.3	60.27	Peak	68.2	Pass
NVNT	n40	5270	Ant1	5150	-48.89	5.3	51.64	Average	54	Pass
NVNT	n40	5310	Ant1	5350	-39.91	5.3	60.62	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350	-49.16	5.3	51.37	Average	54	Pass
NVNT	n40	5310	Ant1	5460	-37.42	5.3	63.11	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5351.2	-48.99	5.3	51.54	Average	54	Pass
NVNT	n40	5310	Ant1	5460	-50.35	5.3	50.18	Average	54	Pass
NVNT	n40	5510	Ant1	5460	-41.37	5.3	59.16	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5460	-49.9	5.3	50.63	Average	54	Pass
NVNT	n40	5510	Ant1	5469.8	-37.52	5.3	63.01	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5469.6	-47.9	5.3	52.63	Average	54	Pass
NVNT	n40	5510	Ant1	5470	-38.06	5.3	62.47	Peak	68.2	Pass
NVNT	n40	5510	Ant1	5470	-48.07	5.3	52.46	Average	54	Pass
NVNT	n40	5670	Ant1	5725	-39.82	5.3	60.71	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5725	-49.41	5.3	51.12	Average	54	Pass
NVNT	n40	5670	Ant1	5729.2	-38.59	5.3	61.94	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5728.2	-49.18	5.3	51.35	Average	54	Pass
NVNT	n40	5670	Ant1	5735	-40.14	5.3	60.39	Peak	68.2	Pass
NVNT	n40	5670	Ant1	5735	-49.59	5.3	50.94	Average	54	Pass
NVNT	n40	5755	Ant1	5650	-41.12	5.3	-35.82	Peak	-27	Pass
NVNT	n40	5755	Ant1	5650	-49.99	5.3	-44.69	Average	-27	Pass
NVNT	n40	5755	Ant1	5700	-36.66	5.3	-31.36	Peak	10	Pass
NVNT	n40	5755	Ant1	5700	-49.23	5.3	-43.93	Average	10	Pass
NVNT	n40	5755	Ant1	5720	-26.72	5.3	-21.42	Peak	15.6	Pass
NVNT	n40	5755	Ant1	5720	-46.21	5.3	-40.91	Average	15.6	Pass
NVNT	n40	5755	Ant1	5725	-27.42	5.3	-22.12	Peak	27	Pass
NVNT	n40	5755	Ant1	5725	-45.12	5.3	-39.82	Average	27	Pass
NVNT	n40	5795	Ant1	5850	-37.51	5.3	-32.21	Peak	27	Pass
NVNT	n40	5795	Ant1	5850	-48.23	5.3	-42.93	Average	27	Pass
NVNT	n40	5795	Ant1	5855	-38.29	5.3	-32.99	Peak	15.6	Pass
NVNT	n40	5795	Ant1	5855	-49.03	5.3	-43.73	Average	15.6	Pass
NVNT	n40	5795	Ant1	5875	-41.05	5.3	-35.75	Peak	10	Pass
NVNT	n40	5795	Ant1	5875	-49.32	5.3	-44.02	Average	10	Pass
NVNT	n40	5795	Ant1	5925	-40.98	5.3	-35.68	Peak	-27	Pass
NVNT	n40	5795	Ant1	5925	-49.49	5.3	-44.19	Average	-27	Pass
NVNT	n40	5190	Ant2	4500	-39.75	5.3	60.78	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-49.95	5.3	50.58	Average	54	Pass
NVNT	n40	5190	Ant2	4679.58	-36.05	5.3	64.48	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-47.82	5.3	52.71	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-38.03	5.3	62.5	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-47.71	5.3	52.82	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-41.81	5.3	58.72	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-50.65	5.3	49.88	Average	54	Pass
NVNT	n40	5230	Ant2	5391.69	-38.07	5.3	62.46	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5447.58	-49.89	5.3	50.64	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-40.77	5.3	59.76	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-50.07	5.3	50.46	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-40.25	5.3	60.28	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-49.92	5.3	50.61	Average	54	Pass
NVNT	n40	5510	Ant2	5469.4	-38.58	5.3	61.95	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469.8	-48.17	5.3	52.36	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-39.16	5.3	61.37	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-48.27	5.3	52.26	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-39.45	5.3	61.08	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-49.38	5.3	51.15	Average	54	Pass



NVNT	n40	5670	Ant2	5728.4	-38.04	5.3	62.49	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5729.4	-49.21	5.3	51.32	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-41.74	5.3	58.79	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-49.36	5.3	51.17	Average	54	Pass
NVNT	n40	5755	Ant2	5650	-40.49	5.3	-35.19	Peak	-27	Pass
NVNT	n40	5755	Ant2	5650	-49.66	5.3	-44.36	Average	-27	Pass
NVNT	n40	5755	Ant2	5700	-40	5.3	-34.7	Peak	10	Pass
NVNT	n40	5755	Ant2	5700	-49.4	5.3	-44.1	Average	10	Pass
NVNT	n40	5755	Ant2	5720	-32.6	5.3	-27.3	Peak	15.6	Pass
NVNT	n40	5755	Ant2	5720	-47.02	5.3	-41.72	Average	15.6	Pass
NVNT	n40	5755	Ant2	5725	-31.88	5.3	-26.58	Peak	27	Pass
NVNT	n40	5755	Ant2	5725	-45.68	5.3	-40.38	Average	27	Pass
NVNT	n40	5795	Ant2	5850	-35.94	5.3	-30.64	Peak	27	Pass
NVNT	n40	5795	Ant2	5850	-48	5.3	-42.7	Average	27	Pass
NVNT	n40	5795	Ant2	5855	-35.18	5.3	-29.88	Peak	15.6	Pass
NVNT	n40	5795	Ant2	5855	-48.27	5.3	-42.97	Average	15.6	Pass
NVNT	n40	5795	Ant2	5875	-38.96	5.3	-33.66	Peak	10	Pass
NVNT	n40	5795	Ant2	5875	-49.24	5.3	-43.94	Average	10	Pass
NVNT	n40	5795	Ant2	5925	-40.9	5.3	-35.6	Peak	-27	Pass
NVNT	n40	5795	Ant2	5925	-49.24	5.3	-43.94	Average	-27	Pass
NVNT	ac20	5180	Ant1	4500	-41.37	5.3	59.16	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-50.75	5.3	49.78	Average	54	Pass
NVNT	ac20	5180	Ant1	4684.1	-36.13	5.3	64.4	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5101.3	-48.79	5.3	51.74	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-40.16	5.3	60.37	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-49.12	5.3	51.41	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-41.33	5.3	59.2	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-51.09	5.3	49.44	Average	54	Pass
NVNT	ac20	5240	Ant1	5413.92	-38.14	5.3	62.39	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5455.44	-50.58	5.3	49.95	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-40.3	5.3	60.23	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-50.71	5.3	49.82	Average	54	Pass
NVNT	ac20	5260	Ant1	4500	-40.07	5.3	60.46	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	4500	-50.61	5.3	49.92	Average	54	Pass
NVNT	ac20	5260	Ant1	5145.06	-36.73	5.3	63.8	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	4694.22	-48.73	5.3	51.8	Average	54	Pass
NVNT	ac20	5260	Ant1	5150	-39.22	5.3	61.31	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5150	-49.45	5.3	51.08	Average	54	Pass
NVNT	ac20	5320	Ant1	5350	-37.19	5.3	63.34	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5350	-50.3	5.3	50.23	Average	54	Pass
NVNT	ac20	5320	Ant1	5350.2	-50.19	5.3	50.34	Average	54	Pass
NVNT	ac20	5320	Ant1	5460	-42.12	5.3	58.41	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5460	-50.73	5.3	49.8	Average	54	Pass
NVNT	ac20	5500	Ant1	5460	-39.47	5.3	61.06	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5460	-50.28	5.3	50.25	Average	54	Pass
NVNT	ac20	5500	Ant1	5464.6	-38.96	5.3	61.57	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5466.8	-49.96	5.3	50.57	Average	54	Pass
NVNT	ac20	5500	Ant1	5470	-41.78	5.3	58.75	Peak	68.2	Pass
NVNT	ac20	5500	Ant1	5470	-50.05	5.3	50.48	Average	54	Pass
NVNT	ac20	5700	Ant1	5725	-38.39	5.3	62.14	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5725	-48.39	5.3	52.14	Average	54	Pass
NVNT	ac20	5700	Ant1	5725.6	-36.42	5.3	64.11	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-40.83	5.3	59.7	Peak	68.2	Pass
NVNT	ac20	5700	Ant1	5735	-49.68	5.3	50.85	Average	54	Pass
NVNT	ac20	5745	Ant1	5650	-40.61	5.3	-35.31	Peak	-27	Pass
NVNT	ac20	5745	Ant1	5650	-50.13	5.3	-44.83	Average	-27	Pass



NVNT	ac20	5745	Ant1	5700	-40.81	5.3	-35.51	Peak	10	Pass
NVNT	ac20	5745	Ant1	5700	-49.58	5.3	-44.28	Average	10	Pass
NVNT	ac20	5745	Ant1	5720	-34.62	5.3	-29.32	Peak	15.6	Pass
NVNT	ac20	5745	Ant1	5720	-49.03	5.3	-43.73	Average	15.6	Pass
NVNT	ac20	5745	Ant1	5725	-27.1	5.3	-21.8	Peak	27	Pass
NVNT	ac20	5745	Ant1	5725	-47.36	5.3	-42.06	Average	27	Pass
NVNT	ac20	5825	Ant1	5850	-23.15	5.3	-17.85	Peak	27	Pass
NVNT	ac20	5825	Ant1	5850	-46.3	5.3	-41	Average	27	Pass
NVNT	ac20	5825	Ant1	5855	-38.62	5.3	-33.32	Peak	15.6	Pass
NVNT	ac20	5825	Ant1	5855	-48.87	5.3	-43.57	Average	15.6	Pass
NVNT	ac20	5825	Ant1	5875	-39.62	5.3	-34.32	Peak	10	Pass
NVNT	ac20	5825	Ant1	5875	-49.83	5.3	-44.53	Average	10	Pass
NVNT	ac20	5825	Ant1	5925	-38.63	5.3	-33.33	Peak	-27	Pass
NVNT	ac20	5825	Ant1	5925	-49.84	5.3	-44.54	Average	-27	Pass
NVNT	ac20	5180	Ant2	4500	-40.79	5.3	59.74	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-50.43	5.3	50.1	Average	54	Pass
NVNT	ac20	5180	Ant2	5050.2	-36.5	5.3	64.03	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4690.4	-48.39	5.3	52.14	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-39.51	5.3	61.02	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-48.97	5.3	51.56	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-40.25	5.3	60.28	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-50.85	5.3	49.68	Average	54	Pass
NVNT	ac20	5240	Ant2	5368.08	-38.76	5.3	61.77	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5441.52	-50.34	5.3	50.19	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-39.1	5.3	61.43	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-50.46	5.3	50.07	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-39.66	5.3	60.87	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-50.33	5.3	50.2	Average	54	Pass
NVNT	ac20	5260	Ant2	4916.52	-36.62	5.3	63.91	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4685.64	-48.38	5.3	52.15	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-38.87	5.3	61.66	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-49.07	5.3	51.46	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-39.42	5.3	61.11	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-50.13	5.3	50.4	Average	54	Pass
NVNT	ac20	5320	Ant2	5442.6	-37.66	5.3	62.87	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5452.4	-50.1	5.3	50.43	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-40.39	5.3	60.14	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-50.28	5.3	50.25	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-40.41	5.3	60.12	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5460	-50.23	5.3	50.3	Average	54	Pass
NVNT	ac20	5500	Ant2	5467.8	-39.31	5.3	61.22	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5469.6	-49.57	5.3	50.96	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-40.61	5.3	59.92	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-49.77	5.3	50.76	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-38.56	5.3	61.97	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-48.74	5.3	51.79	Average	54	Pass
NVNT	ac20	5700	Ant2	5728	-37.61	5.3	62.92	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-40.48	5.3	60.05	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-49.44	5.3	51.09	Average	54	Pass
NVNT	ac20	5745	Ant2	5650	-41.85	5.3	-36.55	Peak	-27	Pass
NVNT	ac20	5745	Ant2	5650	-49.81	5.3	-44.51	Average	-27	Pass
NVNT	ac20	5745	Ant2	5700	-39.66	5.3	-34.36	Peak	10	Pass
NVNT	ac20	5745	Ant2	5700	-49.59	5.3	-44.29	Average	10	Pass
NVNT	ac20	5745	Ant2	5720	-38.93	5.3	-33.63	Peak	15.6	Pass
NVNT	ac20	5745	Ant2	5720	-48.87	5.3	-43.57	Average	15.6	Pass
NVNT	ac20	5745	Ant2	5725	-38.12	5.3	-32.82	Peak	27	Pass



NVNT	ac20	5745	Ant2	5725	-46.72	5.3	-41.42	Average	27	Pass
NVNT	ac20	5825	Ant2	5850	-25.1	5.3	-19.8	Peak	27	Pass
NVNT	ac20	5825	Ant2	5850	-45.73	5.3	-40.43	Average	27	Pass
NVNT	ac20	5825	Ant2	5855	-33.33	5.3	-28.03	Peak	15.6	Pass
NVNT	ac20	5825	Ant2	5855	-47.64	5.3	-42.34	Average	15.6	Pass
NVNT	ac20	5825	Ant2	5875	-39.79	5.3	-34.49	Peak	10	Pass
NVNT	ac20	5825	Ant2	5875	-49.44	5.3	-44.14	Average	10	Pass
NVNT	ac20	5825	Ant2	5925	-40.53	5.3	-35.23	Peak	-27	Pass
NVNT	ac20	5825	Ant2	5925	-49.5	5.3	-44.2	Average	-27	Pass
NVNT	ac40	5190	Ant1	4500	-42.23	5.3	58.3	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-50.61	5.3	49.92	Average	54	Pass
NVNT	ac40	5190	Ant1	5148.24	-36.05	5.3	64.48	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-46.76	5.3	53.77	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-37.93	5.3	62.6	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-46.57	5.3	53.96	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-40.88	5.3	59.65	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-50.76	5.3	49.77	Average	54	Pass
NVNT	ac40	5230	Ant1	5433.81	-38.06	5.3	62.47	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5457.84	-50.38	5.3	50.15	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-41.95	5.3	58.58	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-50.47	5.3	50.06	Average	54	Pass
NVNT	ac40	5270	Ant1	4500	-41.31	5.3	59.22	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4500	-50.29	5.3	50.24	Average	54	Pass
NVNT	ac40	5270	Ant1	5139.09	-36.84	5.3	63.69	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4698.45	-48.28	5.3	52.25	Average	54	Pass
NVNT	ac40	5270	Ant1	5150	-40.14	5.3	60.39	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5150	-49	5.3	51.53	Average	54	Pass
NVNT	ac40	5310	Ant1	5350	-39	5.3	61.53	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350	-49.2	5.3	51.33	Average	54	Pass
NVNT	ac40	5310	Ant1	5350.6	-37.38	5.3	63.15	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350.4	-49.11	5.3	51.42	Average	54	Pass
NVNT	ac40	5310	Ant1	5460	-40.64	5.3	59.89	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5460	-50.56	5.3	49.97	Average	54	Pass
NVNT	ac40	5510	Ant1	5460	-41.2	5.3	59.33	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5460	-49.83	5.3	50.7	Average	54	Pass
NVNT	ac40	5510	Ant1	5469.4	-35.8	5.3	64.73	Peak	68.2	Pass
NVNT	ac40	5510	Ant1	5470	-47.84	5.3	52.69	Average	54	Pass
NVNT	ac40	5510	Ant1	5470	-38.41	5.3	62.12	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-38.59	5.3	61.94	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725	-49.6	5.3	50.93	Average	54	Pass
NVNT	ac40	5670	Ant1	5733.6	-38.01	5.3	62.52	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5725.2	-49.44	5.3	51.09	Average	54	Pass
NVNT	ac40	5670	Ant1	5735	-40.59	5.3	59.94	Peak	68.2	Pass
NVNT	ac40	5670	Ant1	5735	-49.66	5.3	50.87	Average	54	Pass
NVNT	ac40	5755	Ant1	5650	-40.38	5.3	-35.08	Peak	-27	Pass
NVNT	ac40	5755	Ant1	5650	-49.87	5.3	-44.57	Average	-27	Pass
NVNT	ac40	5755	Ant1	5700	-39.1	5.3	-33.8	Peak	10	Pass
NVNT	ac40	5755	Ant1	5700	-49.3	5.3	-44	Average	10	Pass
NVNT	ac40	5755	Ant1	5720	-26.31	5.3	-21.01	Peak	15.6	Pass
NVNT	ac40	5755	Ant1	5720	-46.62	5.3	-41.32	Average	15.6	Pass
NVNT	ac40	5755	Ant1	5725	-29.59	5.3	-24.29	Peak	27	Pass
NVNT	ac40	5755	Ant1	5725	-45.37	5.3	-40.07	Average	27	Pass
NVNT	ac40	5795	Ant1	5850	-35.89	5.3	-30.59	Peak	27	Pass
NVNT	ac40	5795	Ant1	5850	-48.8	5.3	-43.5	Average	27	Pass
NVNT	ac40	5795	Ant1	5855	-39.71	5.3	-34.41	Peak	15.6	Pass
NVNT	ac40	5795	Ant1	5855	-49.1	5.3	-43.8	Average	15.6	Pass



NVNT	ac40	5795	Ant1	5875	-40.82	5.3	-35.52	Peak	10	Pass
NVNT	ac40	5795	Ant1	5875	-49.11	5.3	-43.81	Average	10	Pass
NVNT	ac40	5795	Ant1	5925	-40.52	5.3	-35.22	Peak	-27	Pass
NVNT	ac40	5795	Ant1	5925	-49.52	5.3	-44.22	Average	-27	Pass
NVNT	ac40	5190	Ant2	4500	-40.44	5.3	60.09	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-50.07	5.3	50.46	Average	54	Pass
NVNT	ac40	5190	Ant2	5094.95	-36.27	5.3	64.26	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4696.37	-48.16	5.3	52.37	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-37.8	5.3	62.73	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-48.01	5.3	52.52	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-40.98	5.3	59.55	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-50.42	5.3	50.11	Average	54	Pass
NVNT	ac40	5230	Ant2	5409.51	-38.25	5.3	62.28	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5444.07	-50	5.3	50.53	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-41.52	5.3	59.01	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-50.15	5.3	50.38	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-39.28	5.3	61.25	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-49.47	5.3	51.06	Average	54	Pass
NVNT	ac40	5510	Ant2	5468.4	-36.21	5.3	64.32	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-46.89	5.3	53.64	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-37.8	5.3	62.73	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-39.01	5.3	61.52	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-49.12	5.3	51.41	Average	54	Pass
NVNT	ac40	5670	Ant2	5728.6	-36.56	5.3	63.97	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5728.8	-48.97	5.3	51.56	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-40.14	5.3	60.39	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-49.5	5.3	51.03	Average	54	Pass
NVNT	ac40	5755	Ant2	5650	-41.07	5.3	-35.77	Peak	-27	Pass
NVNT	ac40	5755	Ant2	5650	-49.63	5.3	-44.33	Average	-27	Pass
NVNT	ac40	5755	Ant2	5700	-39.35	5.3	-34.05	Peak	10	Pass
NVNT	ac40	5755	Ant2	5700	-49.29	5.3	-43.99	Average	10	Pass
NVNT	ac40	5755	Ant2	5720	-36.79	5.3	-31.49	Peak	15.6	Pass
NVNT	ac40	5755	Ant2	5720	-47.03	5.3	-41.73	Average	15.6	Pass
NVNT	ac40	5755	Ant2	5725	-34.9	5.3	-29.6	Peak	27	Pass
NVNT	ac40	5755	Ant2	5725	-45.25	5.3	-39.95	Average	27	Pass
NVNT	ac40	5795	Ant2	5850	-34.42	5.3	-29.12	Peak	27	Pass
NVNT	ac40	5795	Ant2	5850	-47.92	5.3	-42.62	Average	27	Pass
NVNT	ac40	5795	Ant2	5855	-39.08	5.3	-33.78	Peak	15.6	Pass
NVNT	ac40	5795	Ant2	5855	-48.51	5.3	-43.21	Average	15.6	Pass
NVNT	ac40	5795	Ant2	5875	-41.48	5.3	-36.18	Peak	10	Pass
NVNT	ac40	5795	Ant2	5875	-49.12	5.3	-43.82	Average	10	Pass
NVNT	ac40	5795	Ant2	5925	-38.4	5.3	-33.1	Peak	-27	Pass
NVNT	ac40	5795	Ant2	5925	-49.08	5.3	-43.78	Average	-27	Pass
NVNT	ac80	5210	Ant1	4500	-41.35	5.3	59.18	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-50.03	5.3	50.5	Average	54	Pass
NVNT	ac80	5210	Ant1	5144.64	-35.9	5.3	64.63	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5147.8	-46.53	5.3	54	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-37.29	5.3	63.24	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-46.73	5.3	53.8	Average	54	Pass
NVNT	ac80	5290	Ant1	4500	-39.65	5.3	60.88	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	4500	-49.95	5.3	50.58	Average	54	Pass
NVNT	ac80	5290	Ant1	5149.02	-35.99	5.3	64.54	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5149.02	-47.24	5.3	53.29	Average	54	Pass
NVNT	ac80	5290	Ant1	5150	-35.28	5.3	65.25	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5150	-47.43	5.3	53.1	Average	54	Pass
NVNT	ac80	5530	Ant1	5460	-40.33	5.3	60.2	Peak	68.2	Pass




NVNT	ac80	5530	Ant1	5460	-48.26	5.3	52.27	Average	54	Pass
NVNT	ac80	5530	Ant1	5465.6	-35.91	5.3	64.62	Peak	68.2	Pass
NVNT	ac80	5530	Ant1	5470	-46.99	5.3	53.54	Average	54	Pass
NVNT	ac80	5530	Ant1	5470	-39.26	5.3	61.27	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-40.4	5.3	60.13	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5725	-49.73	5.3	50.8	Average	54	Pass
NVNT	ac80	5610	Ant1	5734.18	-36.7	5.3	63.83	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5732.95	-46.94	5.3	53.59	Average	54	Pass
NVNT	ac80	5610	Ant1	5735	-39.24	5.3	61.29	Peak	68.2	Pass
NVNT	ac80	5610	Ant1	5735	-48.28	5.3	52.25	Average	54	Pass
NVNT	ac80	5775	Ant1	5650	-38.14	5.3	-32.84	Peak	-27	Pass
NVNT	ac80	5775	Ant1	5650	-48.35	5.3	-43.05	Average	-27	Pass
NVNT	ac80	5775	Ant1	5700	-38.37	5.3	-33.07	Peak	10	Pass
NVNT	ac80	5775	Ant1	5700	-48.29	5.3	-42.99	Average	10	Pass
NVNT	ac80	5775	Ant1	5720	-37.91	5.3	-32.61	Peak	15.6	Pass
NVNT	ac80	5775	Ant1	5720	-46.8	5.3	-41.5	Average	15.6	Pass
NVNT	ac80	5775	Ant1	5725	-34.81	5.3	-29.51	Peak	27	Pass
NVNT	ac80	5775	Ant1	5725	-46.22	5.3	-40.92	Average	27	Pass
NVNT	ac80	5210	Ant2	4500	-41.08	5.3	59.45	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-49.52	5.3	51.01	Average	54	Pass
NVNT	ac80	5210	Ant2	5147.8	-35.62	5.3	64.91	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5146.22	-46.59	5.3	53.94	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-38.2	5.3	62.33	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-46.68	5.3	53.85	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-38.43	5.3	62.1	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-49.47	5.3	51.06	Average	54	Pass
NVNT	ac80	5290	Ant2	5083.77	-36.28	5.3	64.25	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4691.4	-47.4	5.3	53.13	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-37.4	5.3	63.13	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-47.46	5.3	53.07	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-39.66	5.3	60.87	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-48	5.3	52.53	Average	54	Pass
NVNT	ac80	5530	Ant2	5464.8	-36.08	5.3	64.45	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-46.55	5.3	53.98	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-38.07	5.3	62.46	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-39.82	5.3	60.71	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-49.35	5.3	51.18	Average	54	Pass
NVNT	ac80	5610	Ant2	5732.13	-37.7	5.3	62.83	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5732.54	-46.62	5.3	53.91	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-39.87	5.3	60.66	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-47.92	5.3	52.61	Average	54	Pass
NVNT	ac80	5775	Ant2	5650	-40.21	5.3	-34.91	Peak	-27	Pass
NVNT	ac80	5775	Ant2	5650	-48.38	5.3	-43.08	Average	-27	Pass
NVNT	ac80	5775	Ant2	5700	-38.42	5.3	-33.12	Peak	10	Pass
NVNT	ac80	5775	Ant2	5700	-48.64	5.3	-43.34	Average	10	Pass
NVNT	ac80	5775	Ant2	5720	-38.95	5.3	-33.65	Peak	15.6	Pass
NVNT	ac80	5775	Ant2	5720	-47.42	5.3	-42.12	Average	15.6	Pass
NVNT	ac80	5775	Ant2	5725	-35.62	5.3	-30.32	Peak	27	Pass
NVNT	ac80	5775	Ant2	5725	-46.9	5.3	-41.6	Average	27	Pass




Test Graphs


Restrict Band NVNT a 5180MHz Ant1 Peak

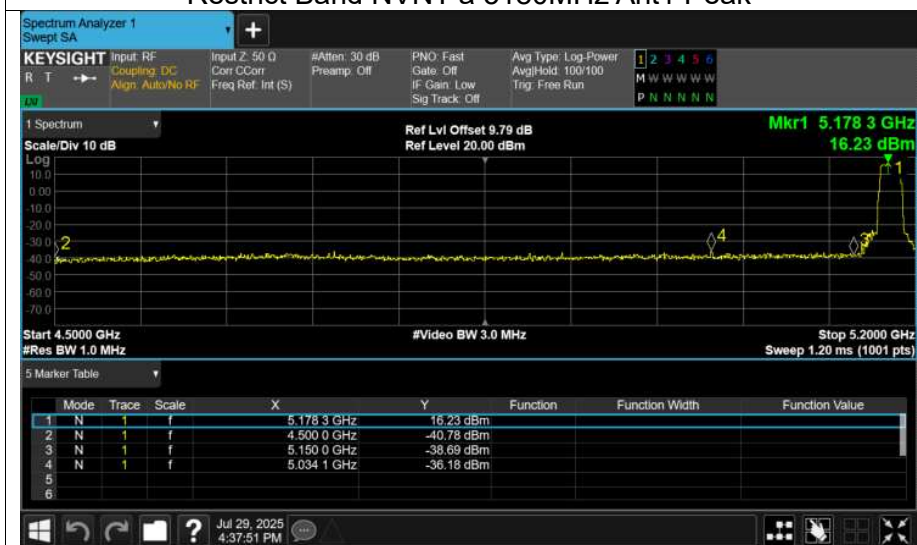

Restrict Band NVNT a 5180MHz Ant1 Average

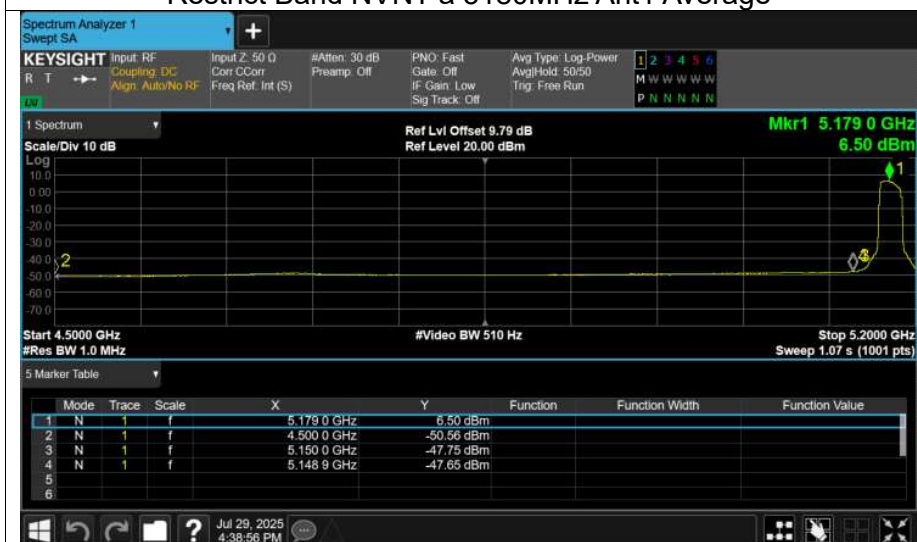

Restrict Band NVNT a 5240MHz Ant1 Peak

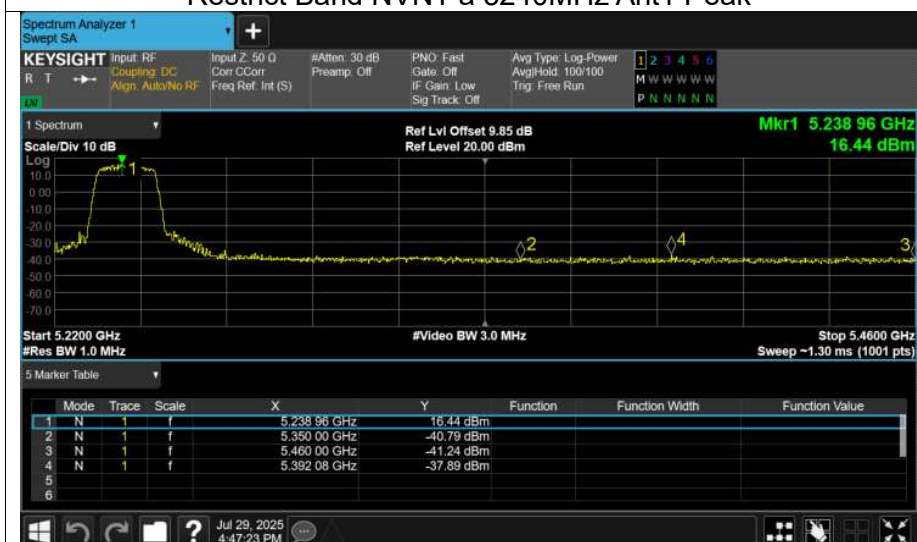





Restrict Band NVNT a 5240MHz Ant1 Average



Restrict Band NVNT a 5260MHz Ant1 Peak

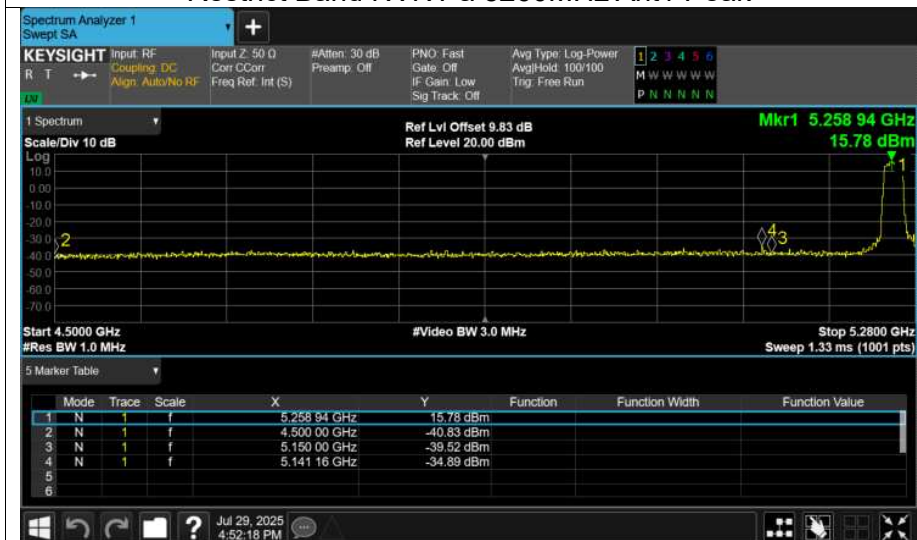

Restrict Band NVNT a 5260MHz Ant1 Average

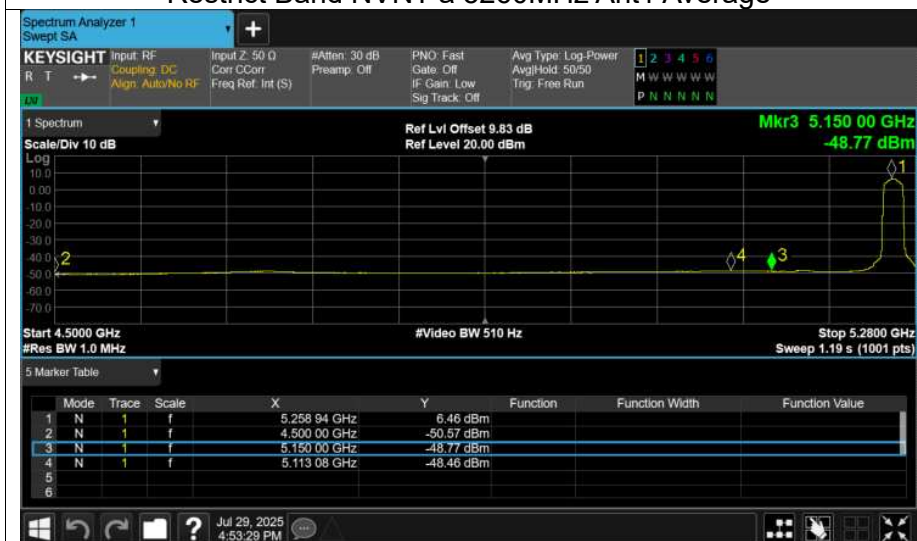




Restrict Band NVNT a 5320MHz Ant1 Peak



Restrict Band NVNT a 5320MHz Ant1 Average



Restrict Band NVNT a 5500MHz Ant1 Peak

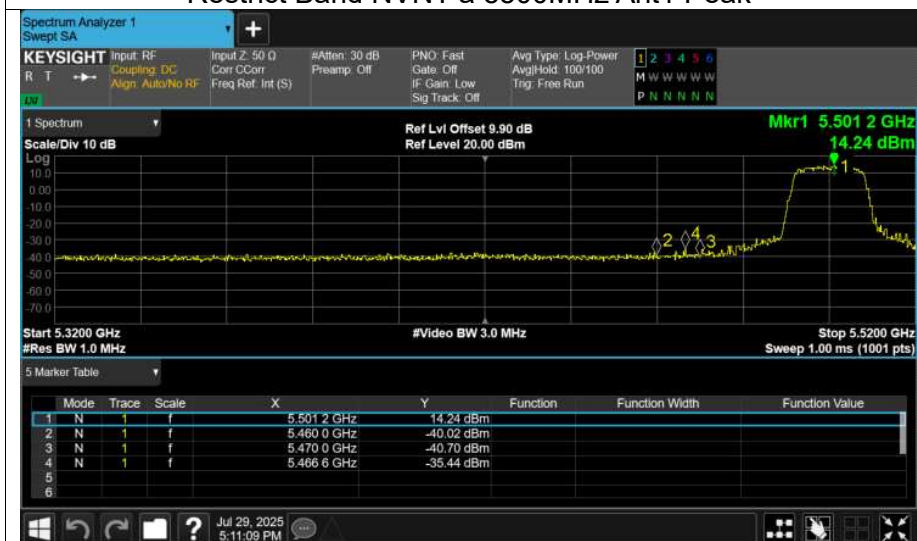



Restrict Band NVNT a 5500MHz Ant1 Average



Restrict Band NVNT a 5700MHz Ant1 Peak



Restrict Band NVNT a 5700MHz Ant1 Average





Restrict Band NVNT a 5745MHz Ant1 Peak



Restrict Band NVNT a 5745MHz Ant1 Average



Restrict Band NVNT a 5825MHz Ant1 Peak






Restrict Band NVNT a 5825MHz Ant1 Average



Restrict Band NVNT a 5180MHz Ant2 Peak

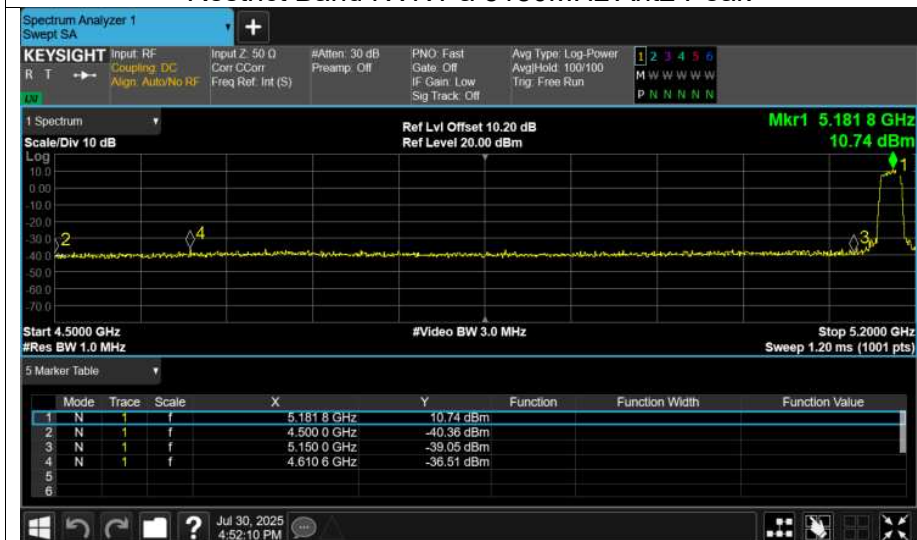

Restrict Band NVNT a 5180MHz Ant2 Average






Restrict Band NVNT a 5240MHz Ant2 Peak




Restrict Band NVNT a 5240MHz Ant2 Average




Restrict Band NVNT a 5260MHz Ant2 Peak

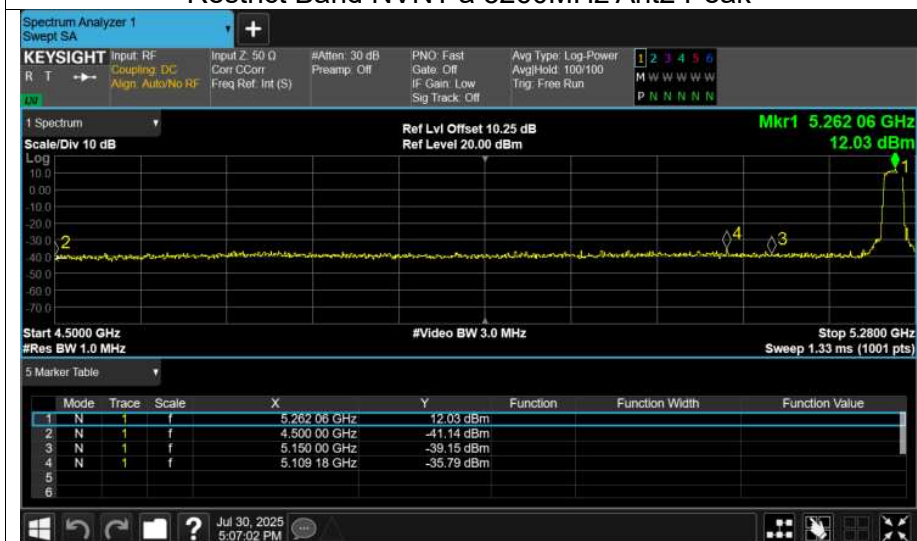

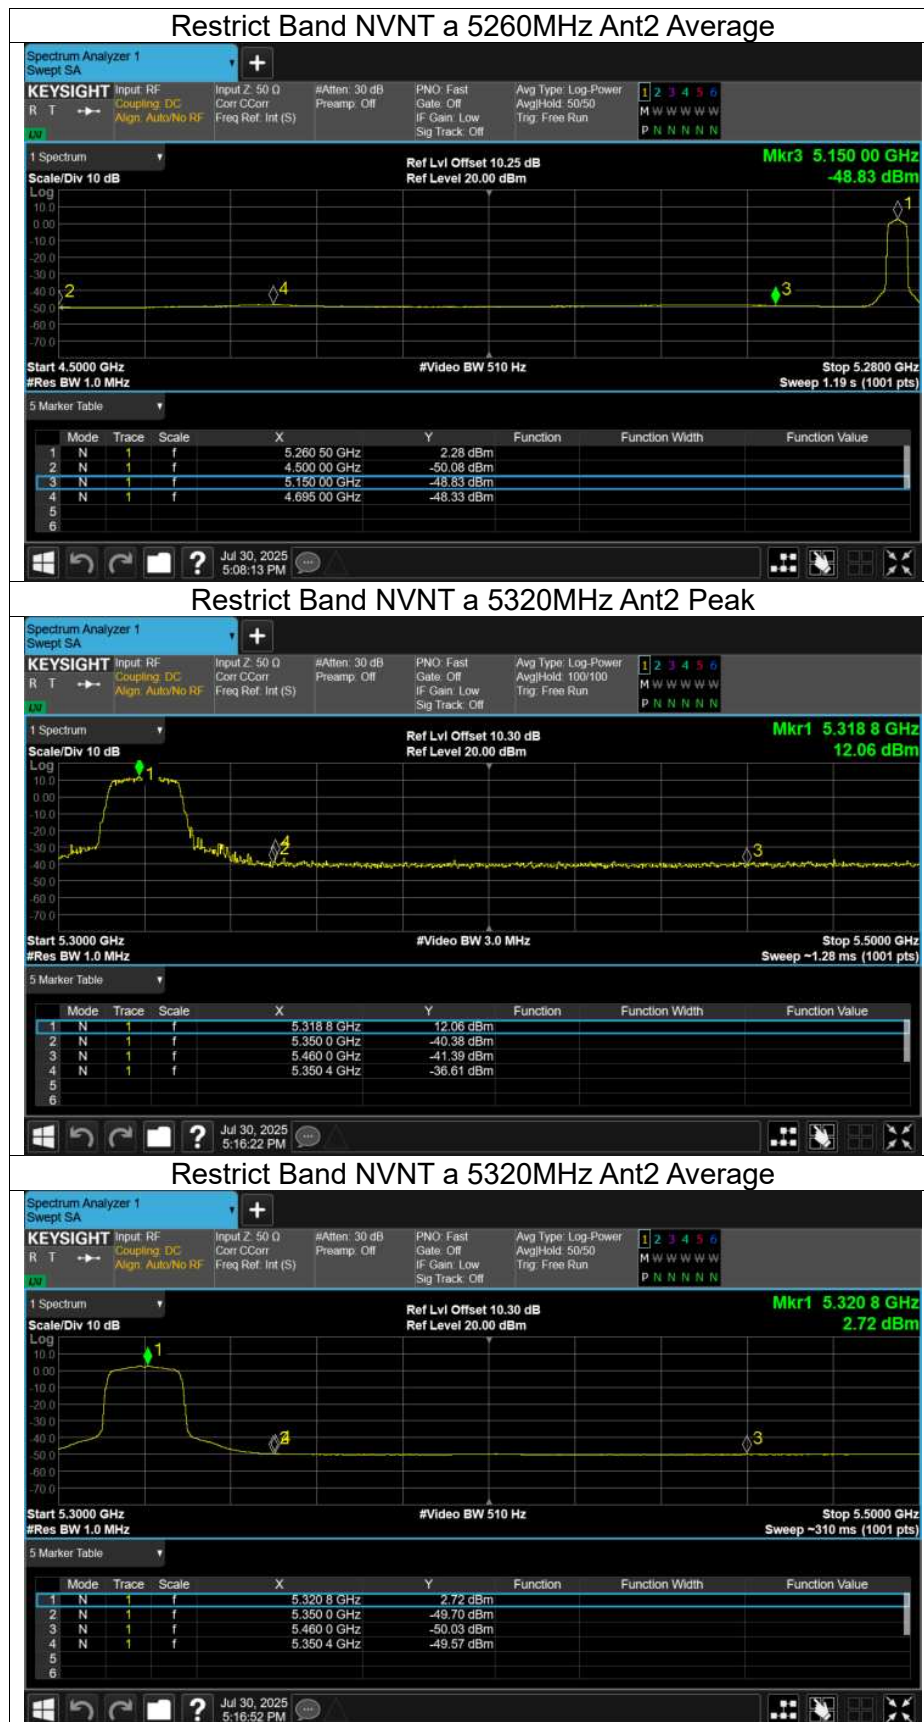



Restrict Band NVNT a 5500MHz Ant2 Peak

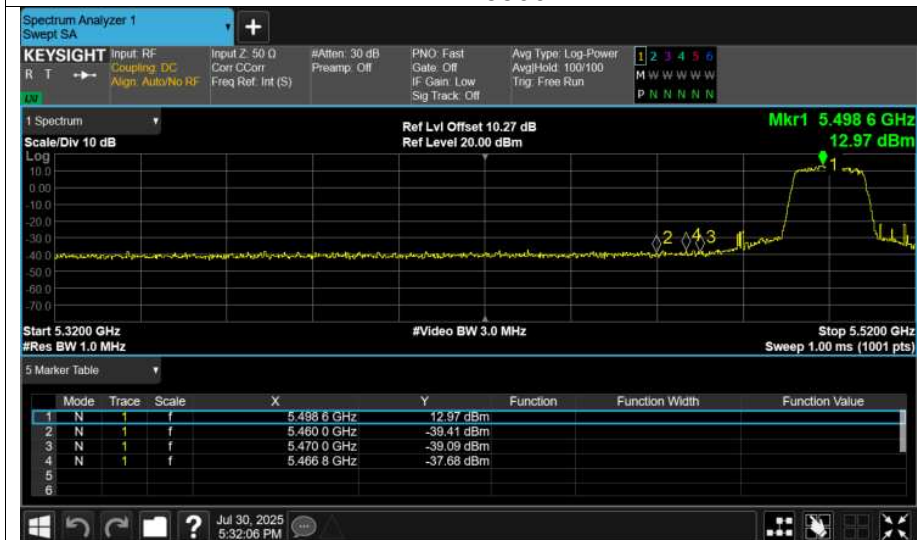

Restrict Band NVNT a 5500MHz Ant2 Average



Restrict Band NVNT a 5700MHz Ant2 Peak






Restrict Band NVNT a 5700MHz Ant2 Average



Restrict Band NVNT a 5745MHz Ant2 Peak

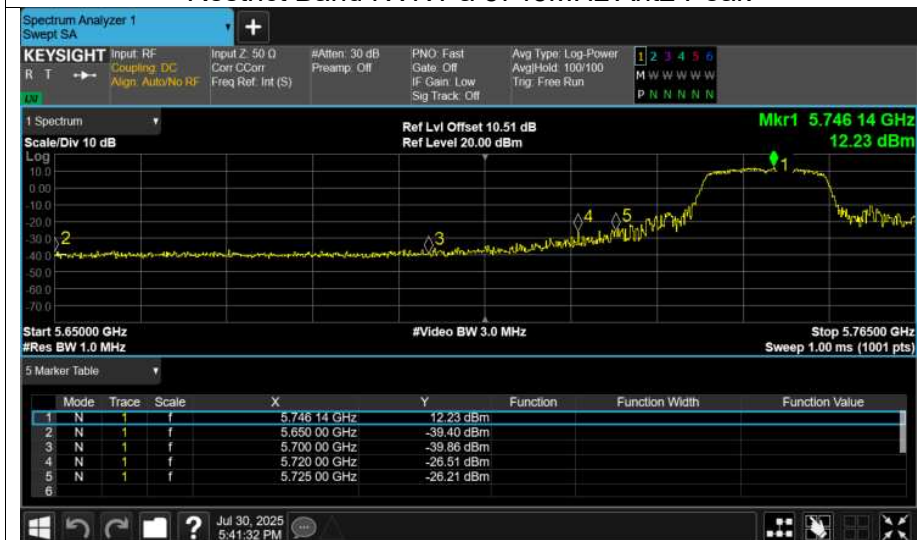

Restrict Band NVNT a 5745MHz Ant2 Average






Restrict Band NVNT a 5825MHz Ant2 Peak



Restrict Band NVNT a 5825MHz Ant2 Average



Restrict Band NVNT n20 5180MHz Ant1 Peak

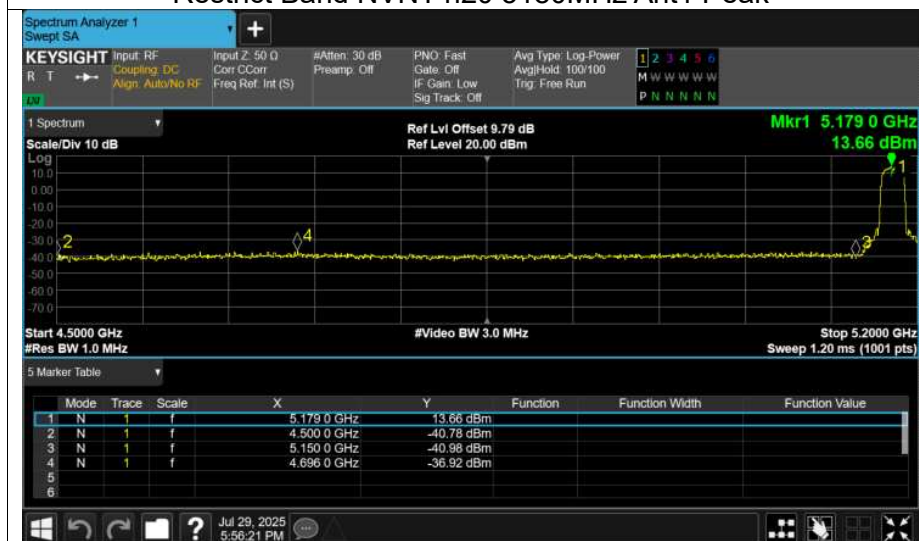



Restrict Band NVNT n20 5180MHz Ant1 Average






Restrict Band NVNT n20 5240MHz Ant1 Peak



Restrict Band NVNT n20 5240MHz Ant1 Average



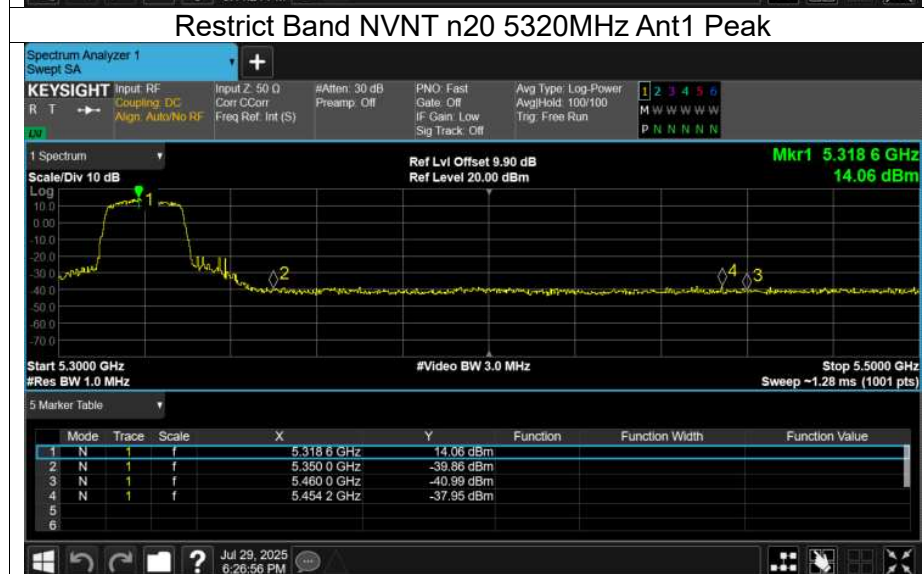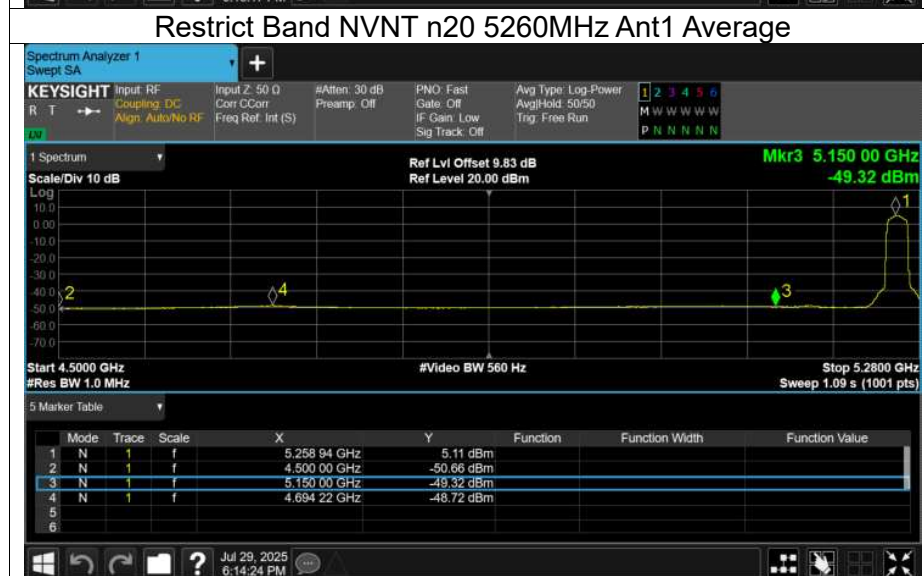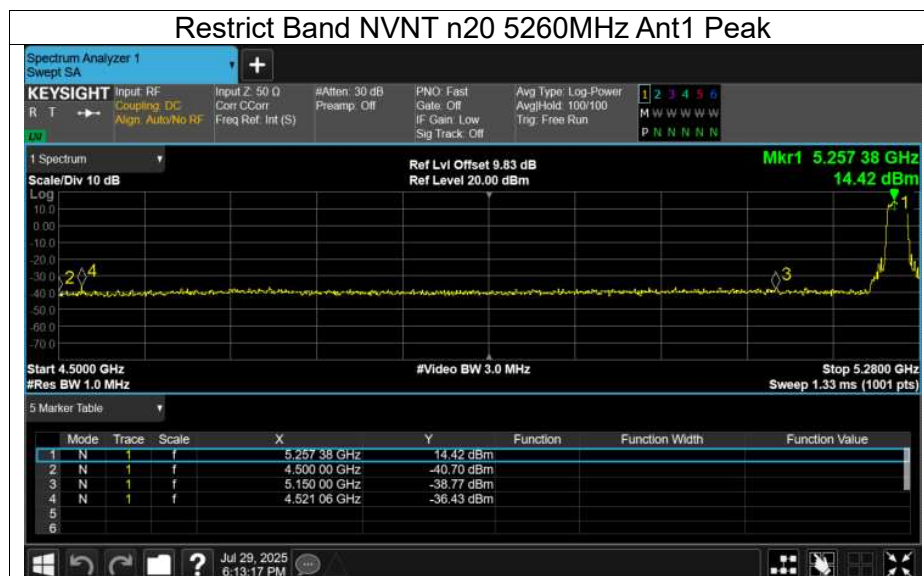




Restrict Band NVNT n20 5320MHz Ant1 Average






Restrict Band NVNT n20 5500MHz Ant1 Peak

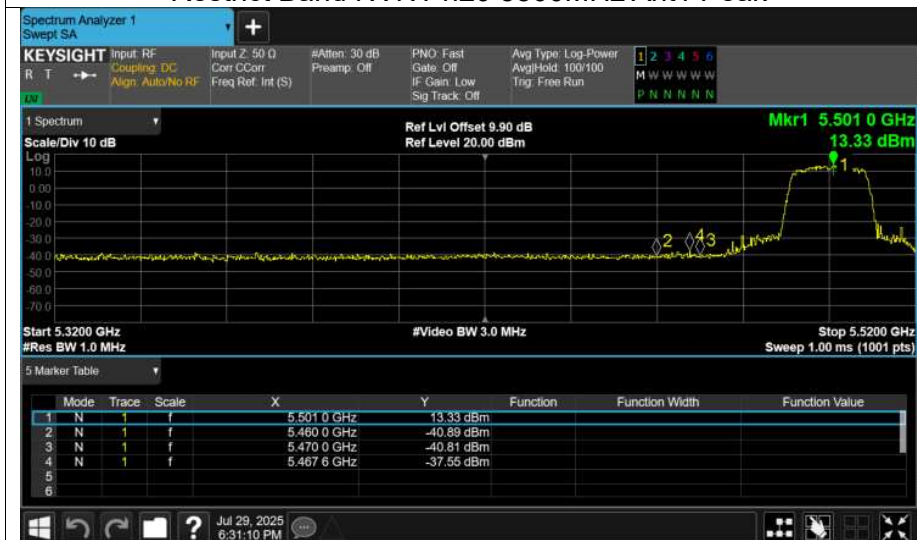

Restrict Band NVNT n20 5500MHz Ant1 Average



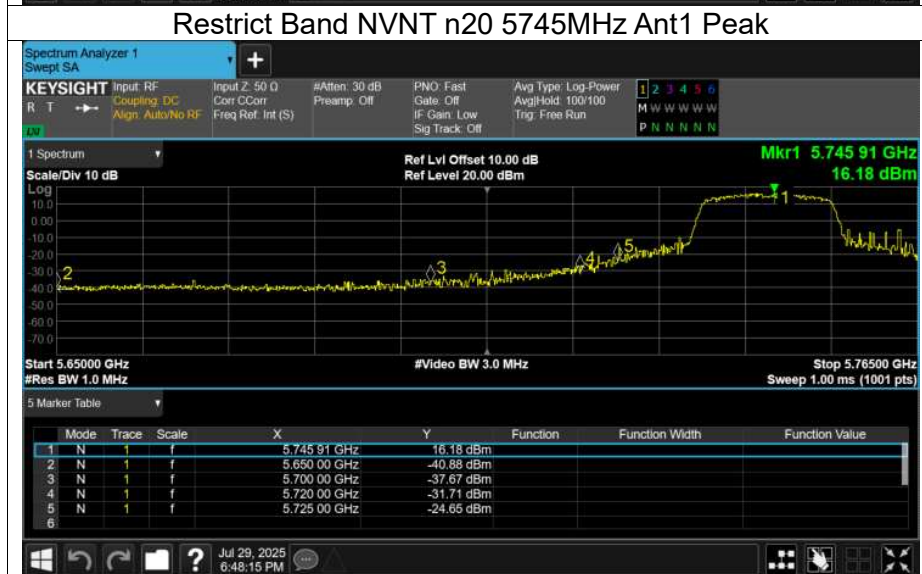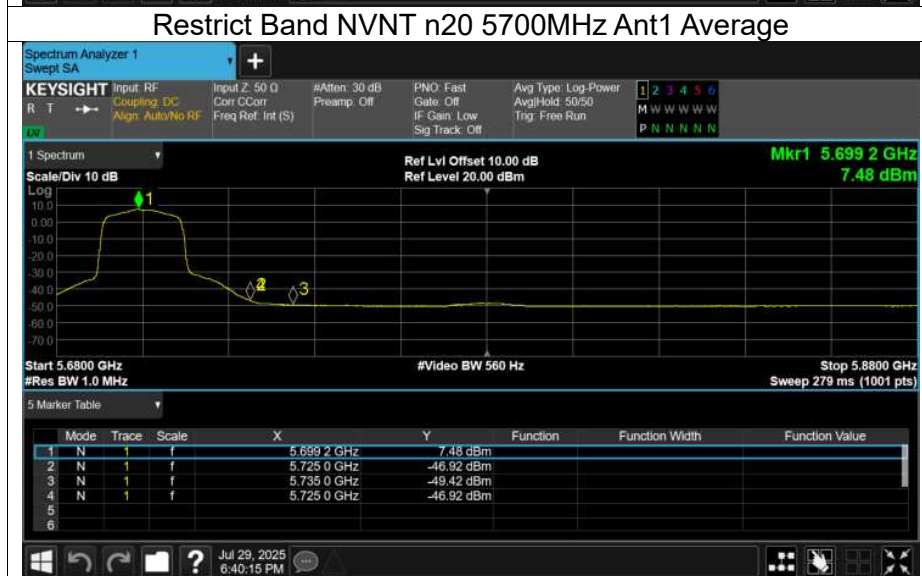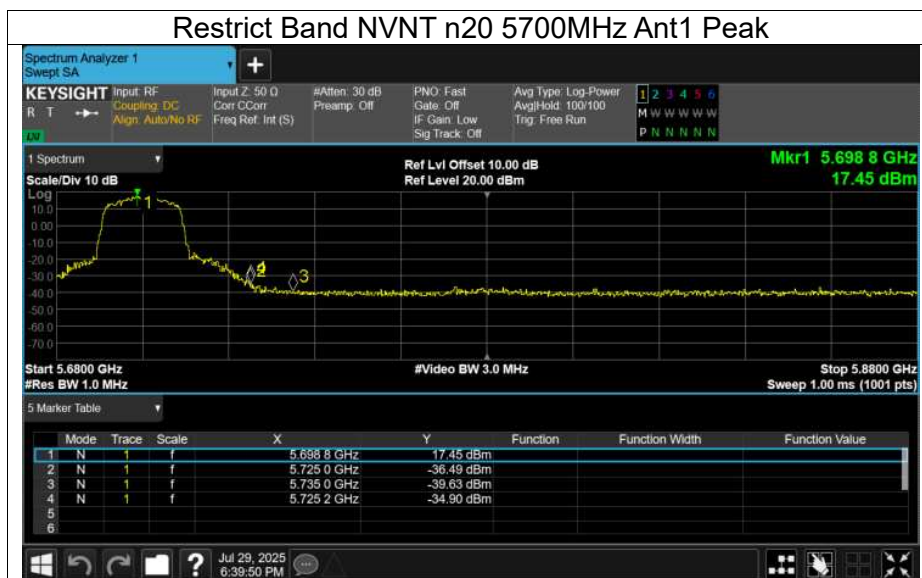



Restrict Band NVNT n20 5745MHz Ant1 Average







Restrict Band NVNT n20 5825MHz Ant1 Peak






Restrict Band NVNT n20 5825MHz Ant1 Average



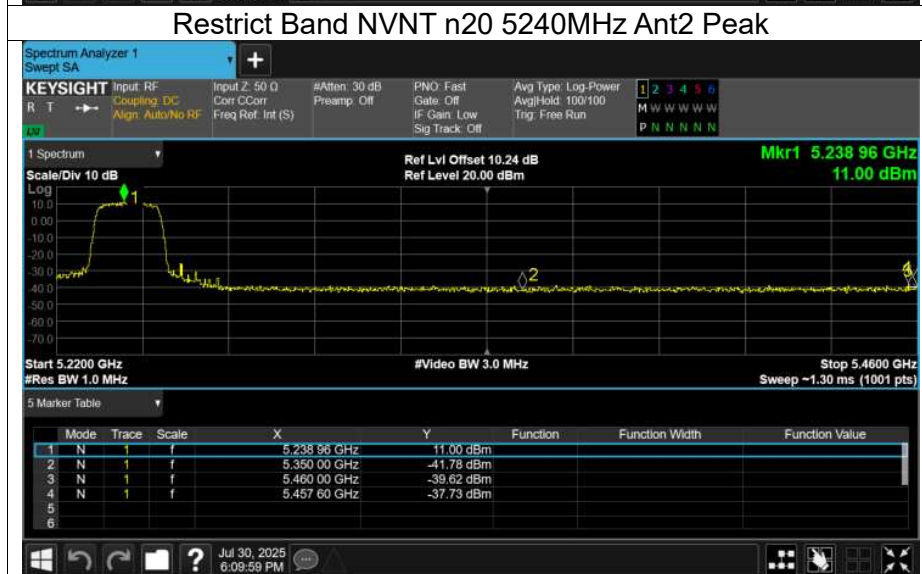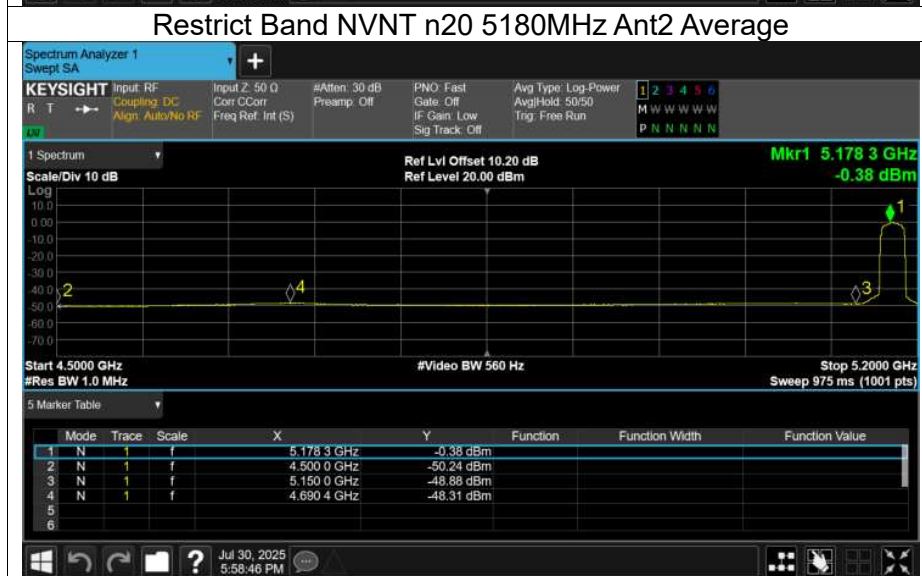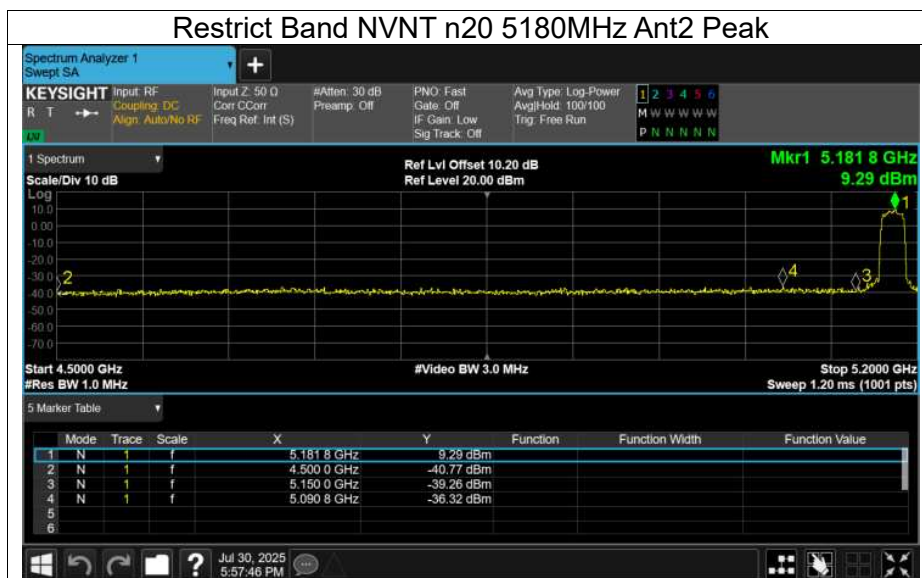

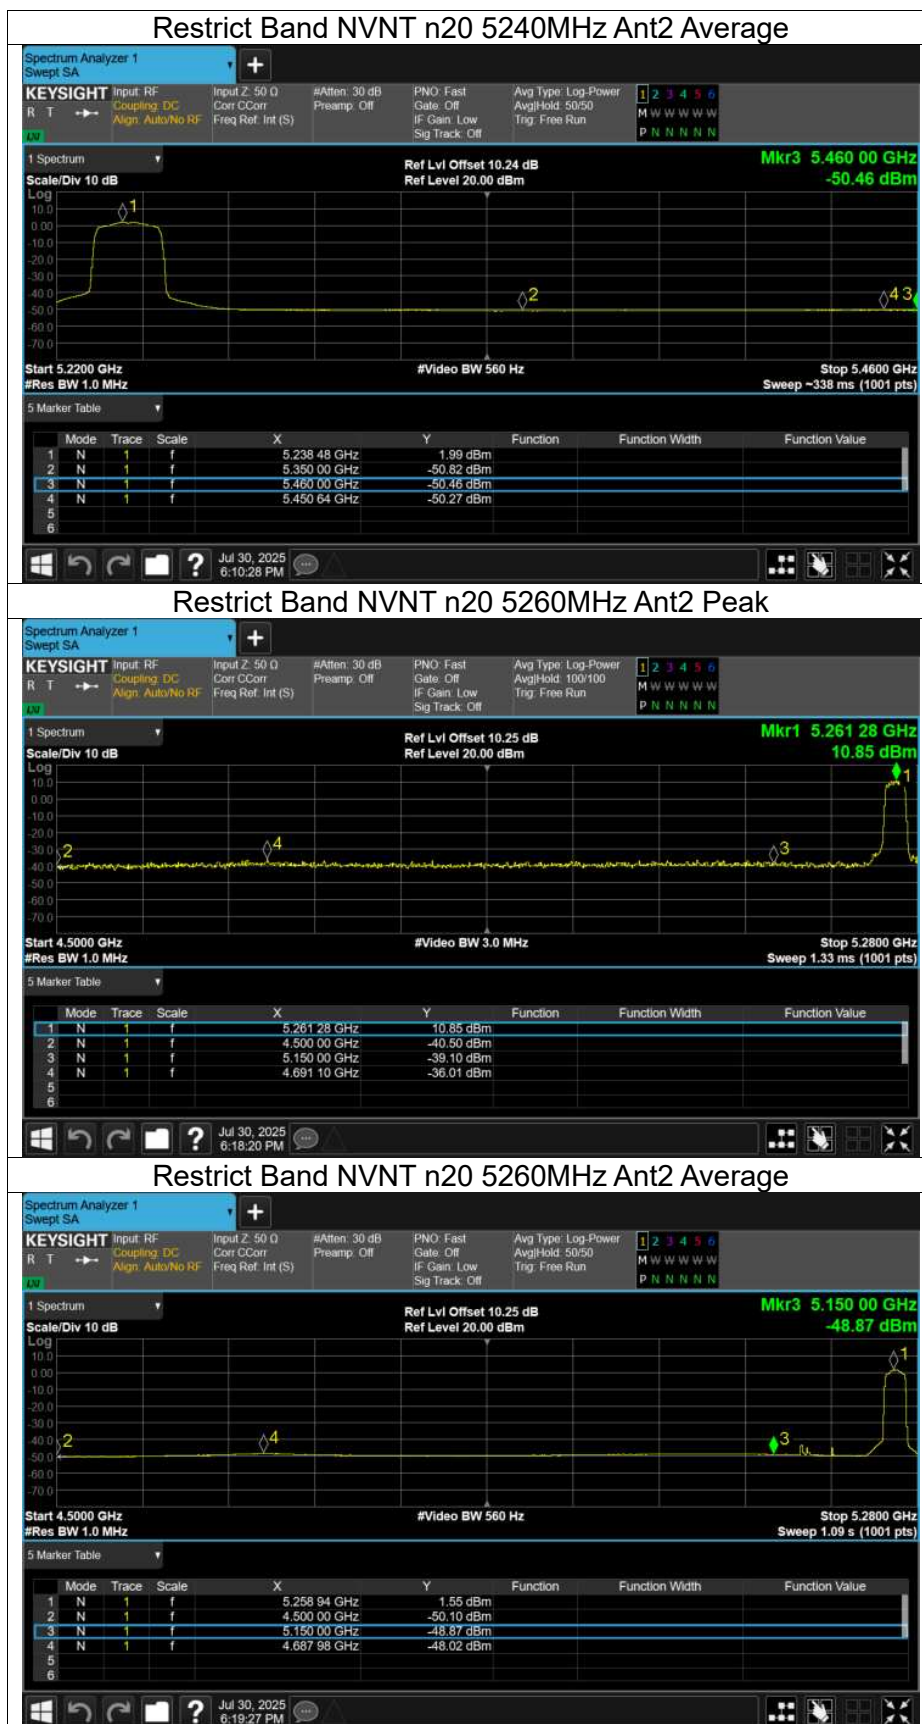

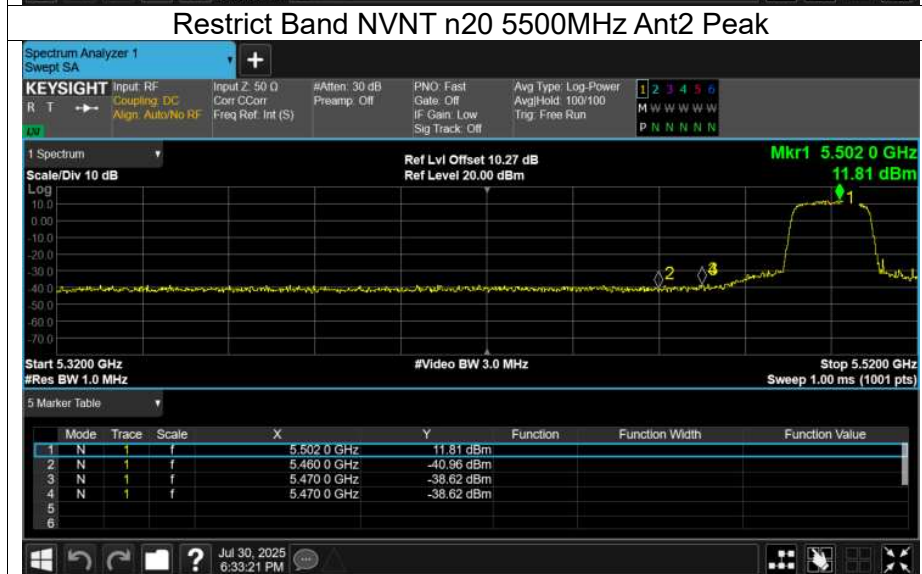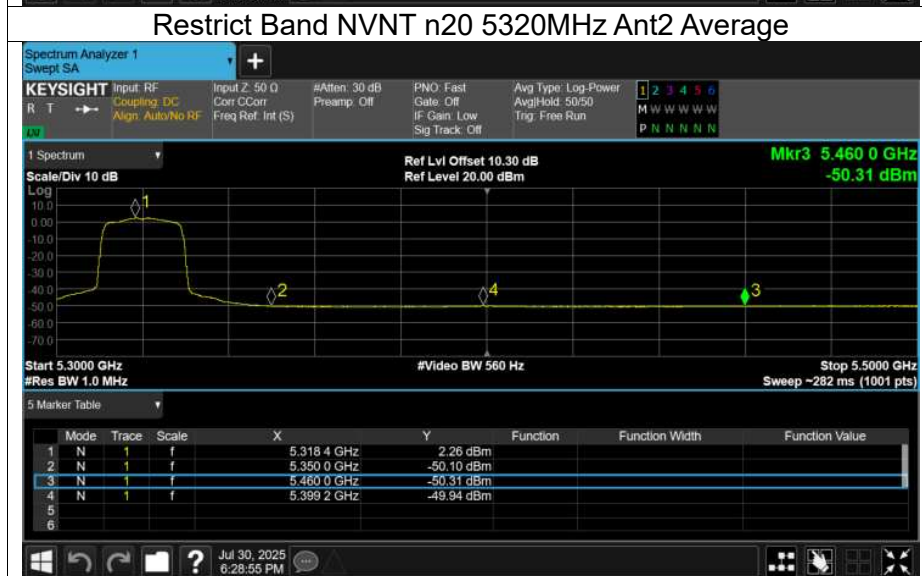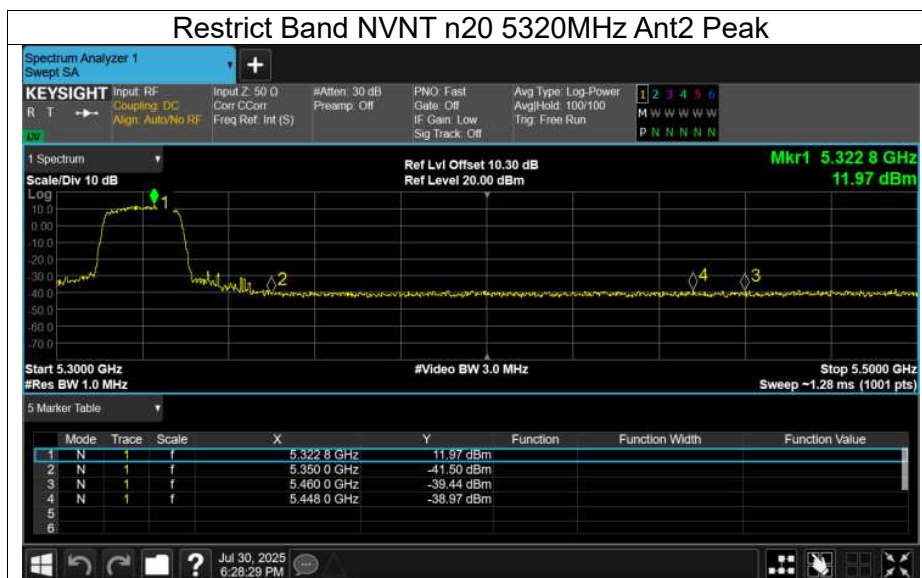



Restrict Band NVNT n20 5500MHz Ant2 Average






Restrict Band NVNT n20 5700MHz Ant2 Peak



Restrict Band NVNT n20 5700MHz Ant2 Average



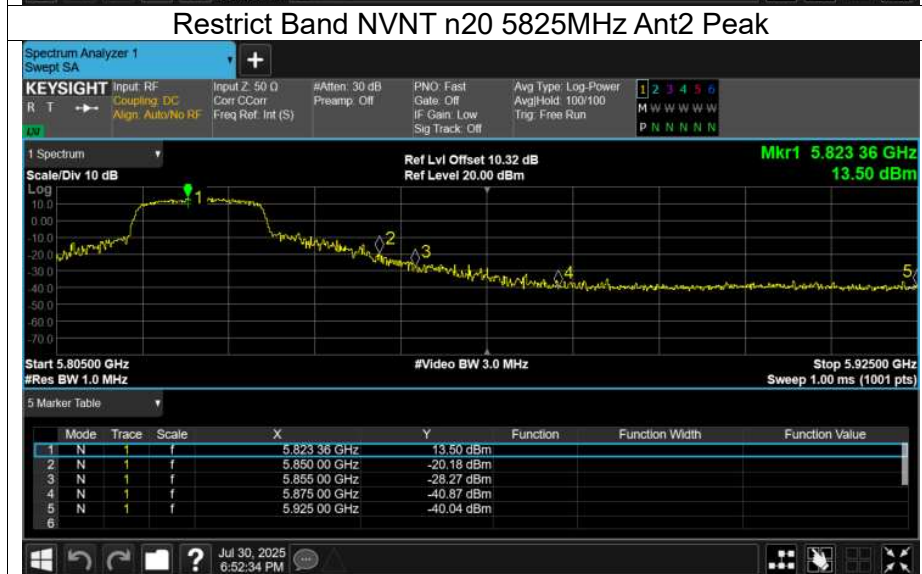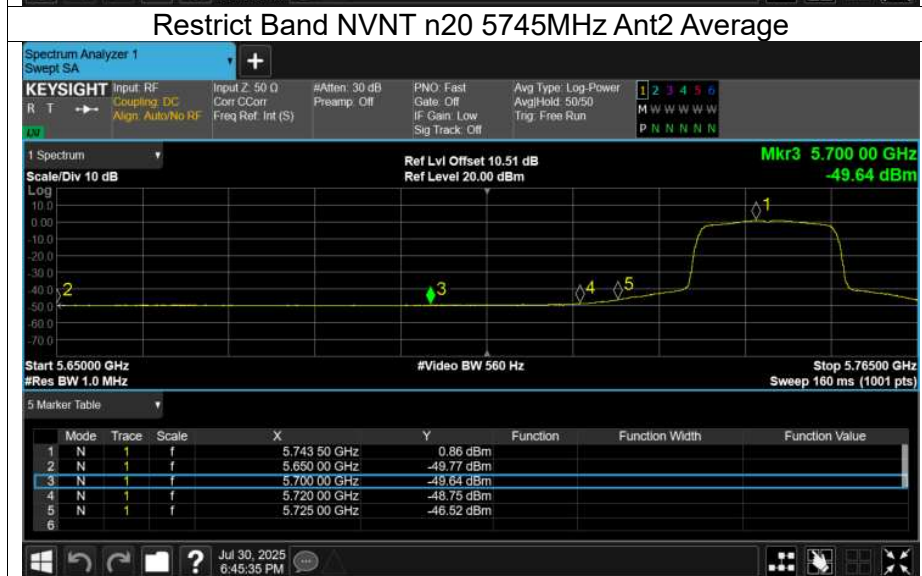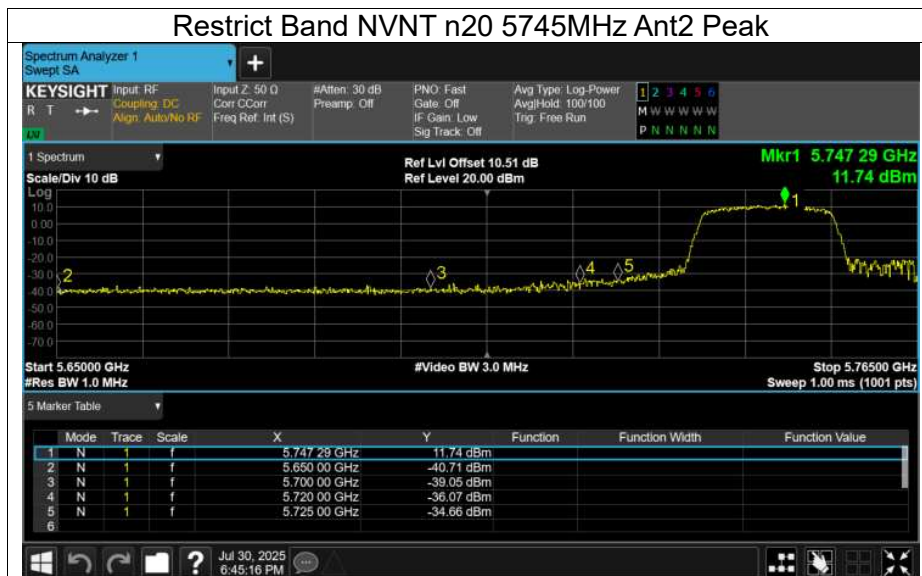




Restrict Band NVNT n20 5825MHz Ant2 Average




Restrict Band NVNT n40 5190MHz Ant1 Peak

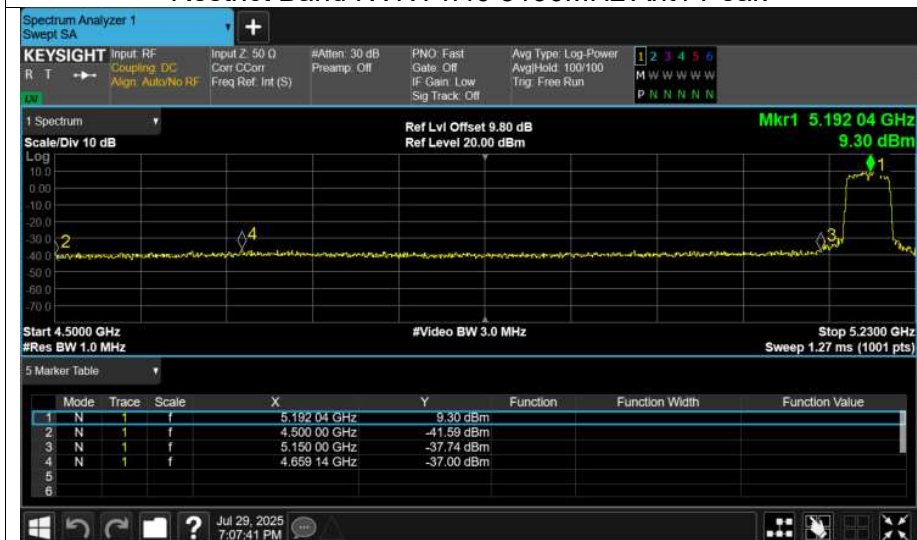

Restrict Band NVNT n40 5190MHz Ant1 Average



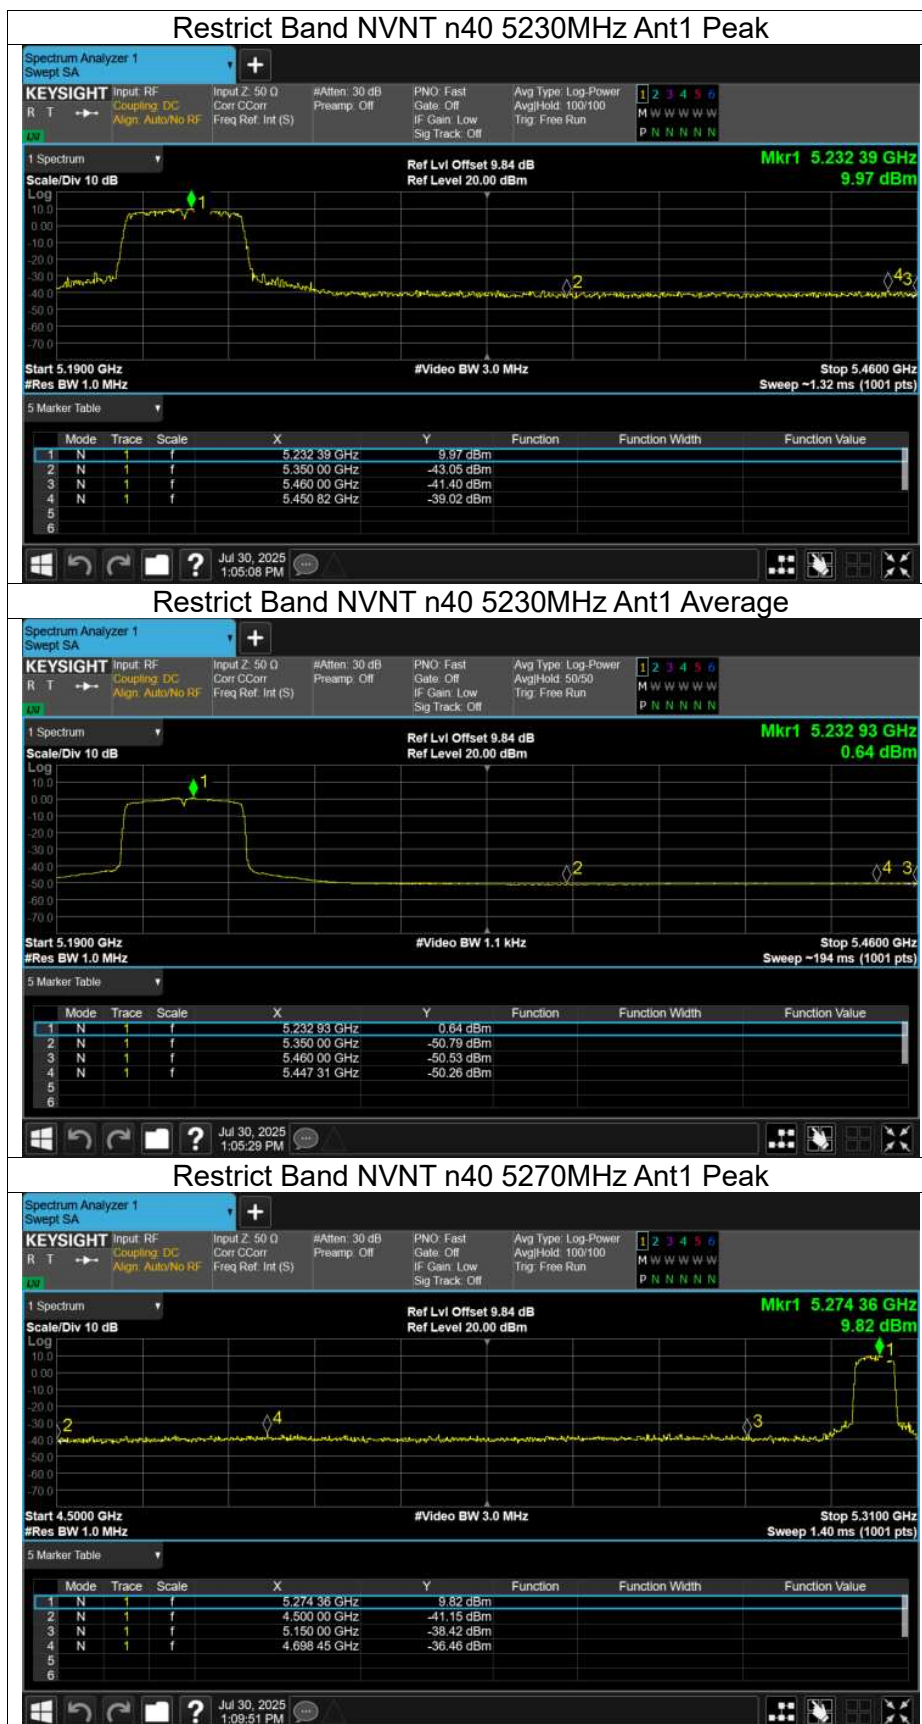




Restrict Band NVNT n40 5270MHz Ant1 Average



Restrict Band NVNT n40 5310MHz Ant1 Peak

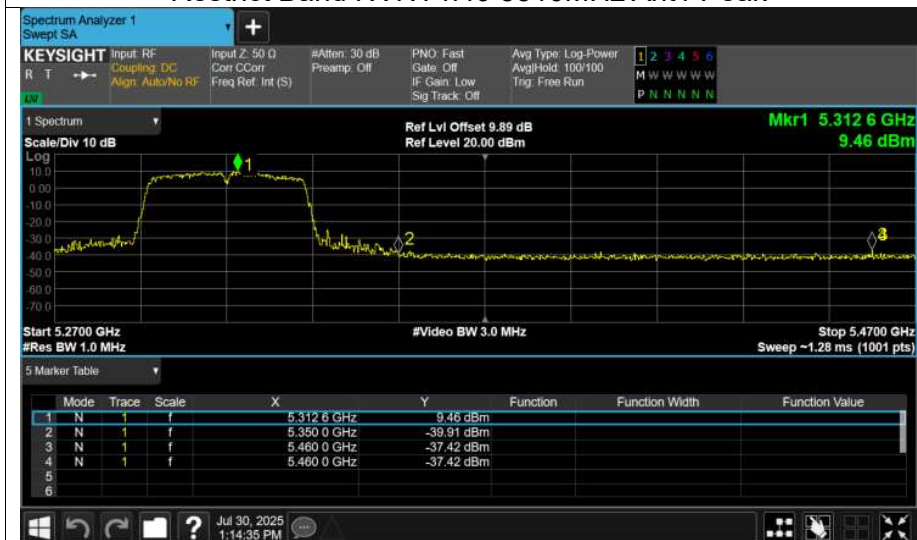

Restrict Band NVNT n40 5310MHz Ant1 Average

