



Shenzhen CTL Testing Technology Co., Ltd.

Floor 1-A, Baisha Technology Park, No.3011, Shahexi Road, Nanshan District, Shenzhen, China 518055

Tel: +86-755-89486194 E-mail: ctl@ctl-lab.com

Annex for Bluetooth

Test Report No.: CTL2504014011-WF01

Content

Annex for Bluetooth	1
1. Bandwidth.....	3
1.1 Test Result	3
1.1.1 OBW.....	3
1.1.2 20dB BW	3
1.2 Test Graph.....	4
1.2.1 OBW.....	4
1.2.2 20dB BW	9
2. Maximum Conducted Output Power	14
2.1 Test Result	14
2.1.1 Power	14
2.2 Test Graph.....	15
2.2.1 Power	15
3. Carrier Frequency Separation.....	20
3.1 Test Result	20
3.1.1 Ant1	20
3.2 Test Graph.....	21
3.2.1 Ant1	21

FCC ID: 2BDUR-1202260

4. Number of Hopping Frequencies	23
4.1 Test Result	23
4.1.1 HoppNum	23
4.2 Test Graph.....	24
4.2.1 HoppNum	24
5. Time of Occupancy (Dwell Time)	26
5.1 Test Result	26
5.1.1 Ant1	26
5.2 Test Graph.....	27
5.2.1 Ant1	27
6. Unwanted Emissions In Non-restricted Frequency Bands.....	36
6.1 Test Result	36
6.1.1 Ref.....	36
6.1.2 CSE	36
6.2 Test Graph.....	37
6.2.1 Ref.....	37
6.2.2 CSE	42

FCC ID: 2BDUR-1202260

1. Bandwidth

1.1 Test Result

1.1.1 OBW

Mode	TX Type	Frequency (MHz)	Packet Type	ANT	99% Occupied Bandwidth (MHz)		Verdict
					Result	Limit	
GFSK	SISO	2402	DH5	1	0.853	/	Pass
		2441	DH5	1	0.852	/	Pass
		2480	DH5	1	0.852	/	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	1.162	/	Pass
		2441	2DH5	1	1.161	/	Pass
		2480	2DH5	1	1.163	/	Pass
8DPSK	SISO	2402	3DH5	1	1.156	/	Pass
		2441	3DH5	1	1.159	/	Pass
		2480	3DH5	1	1.155	/	Pass


1.1.2 20dB BW

Mode	TX Type	Frequency (MHz)	Packet Type	ANT	20dB Bandwidth (MHz)		Verdict
					Result	Limit	
GFSK	SISO	2402	DH5	1	0.939	/	Pass
		2441	DH5	1	0.942	/	Pass
		2480	DH5	1	0.945	/	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	1.276	/	Pass
		2441	2DH5	1	1.275	/	Pass
		2480	2DH5	1	1.281	/	Pass
8DPSK	SISO	2402	3DH5	1	1.262	/	Pass
		2441	3DH5	1	1.260	/	Pass
		2480	3DH5	1	1.263	/	Pass


FCC ID: 2BDUR-1202260

1.2 Test Graph


1.2.1 OBW

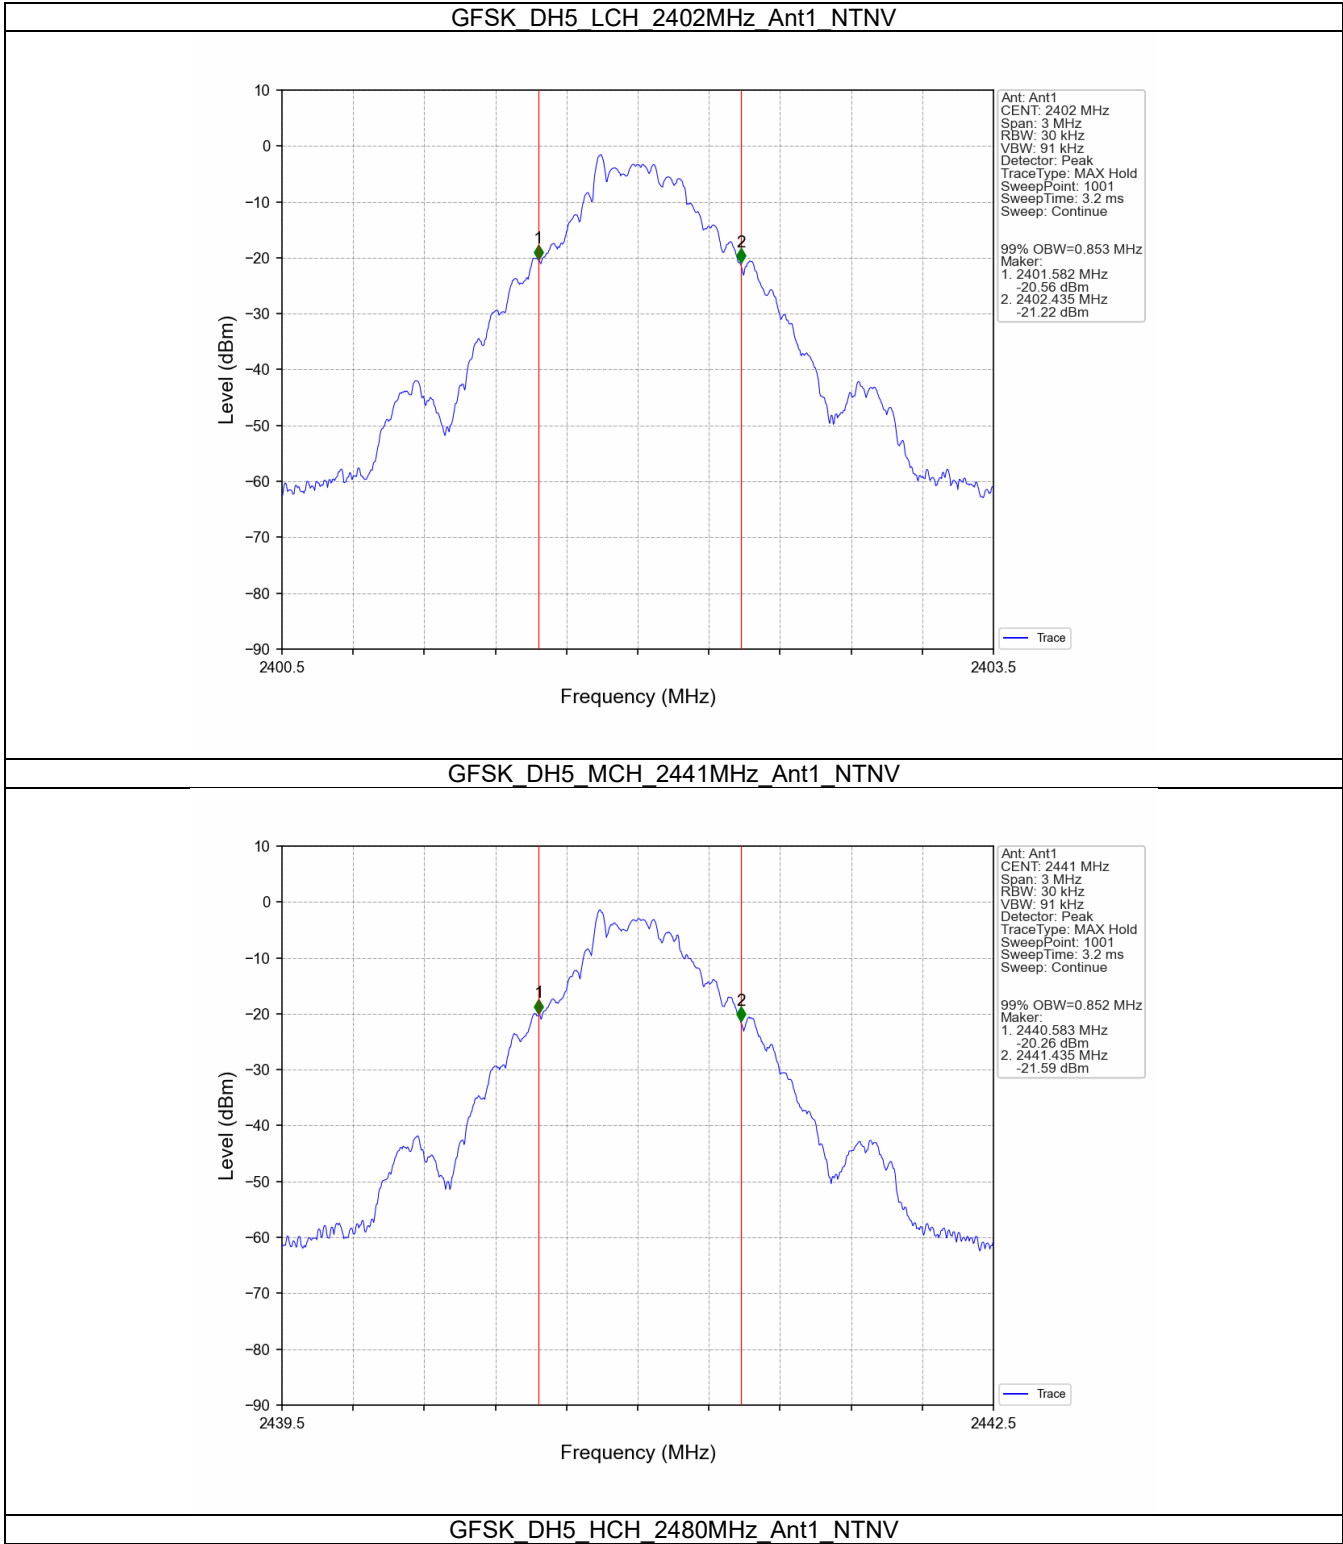


FCC ID: 2BDUR-1202260

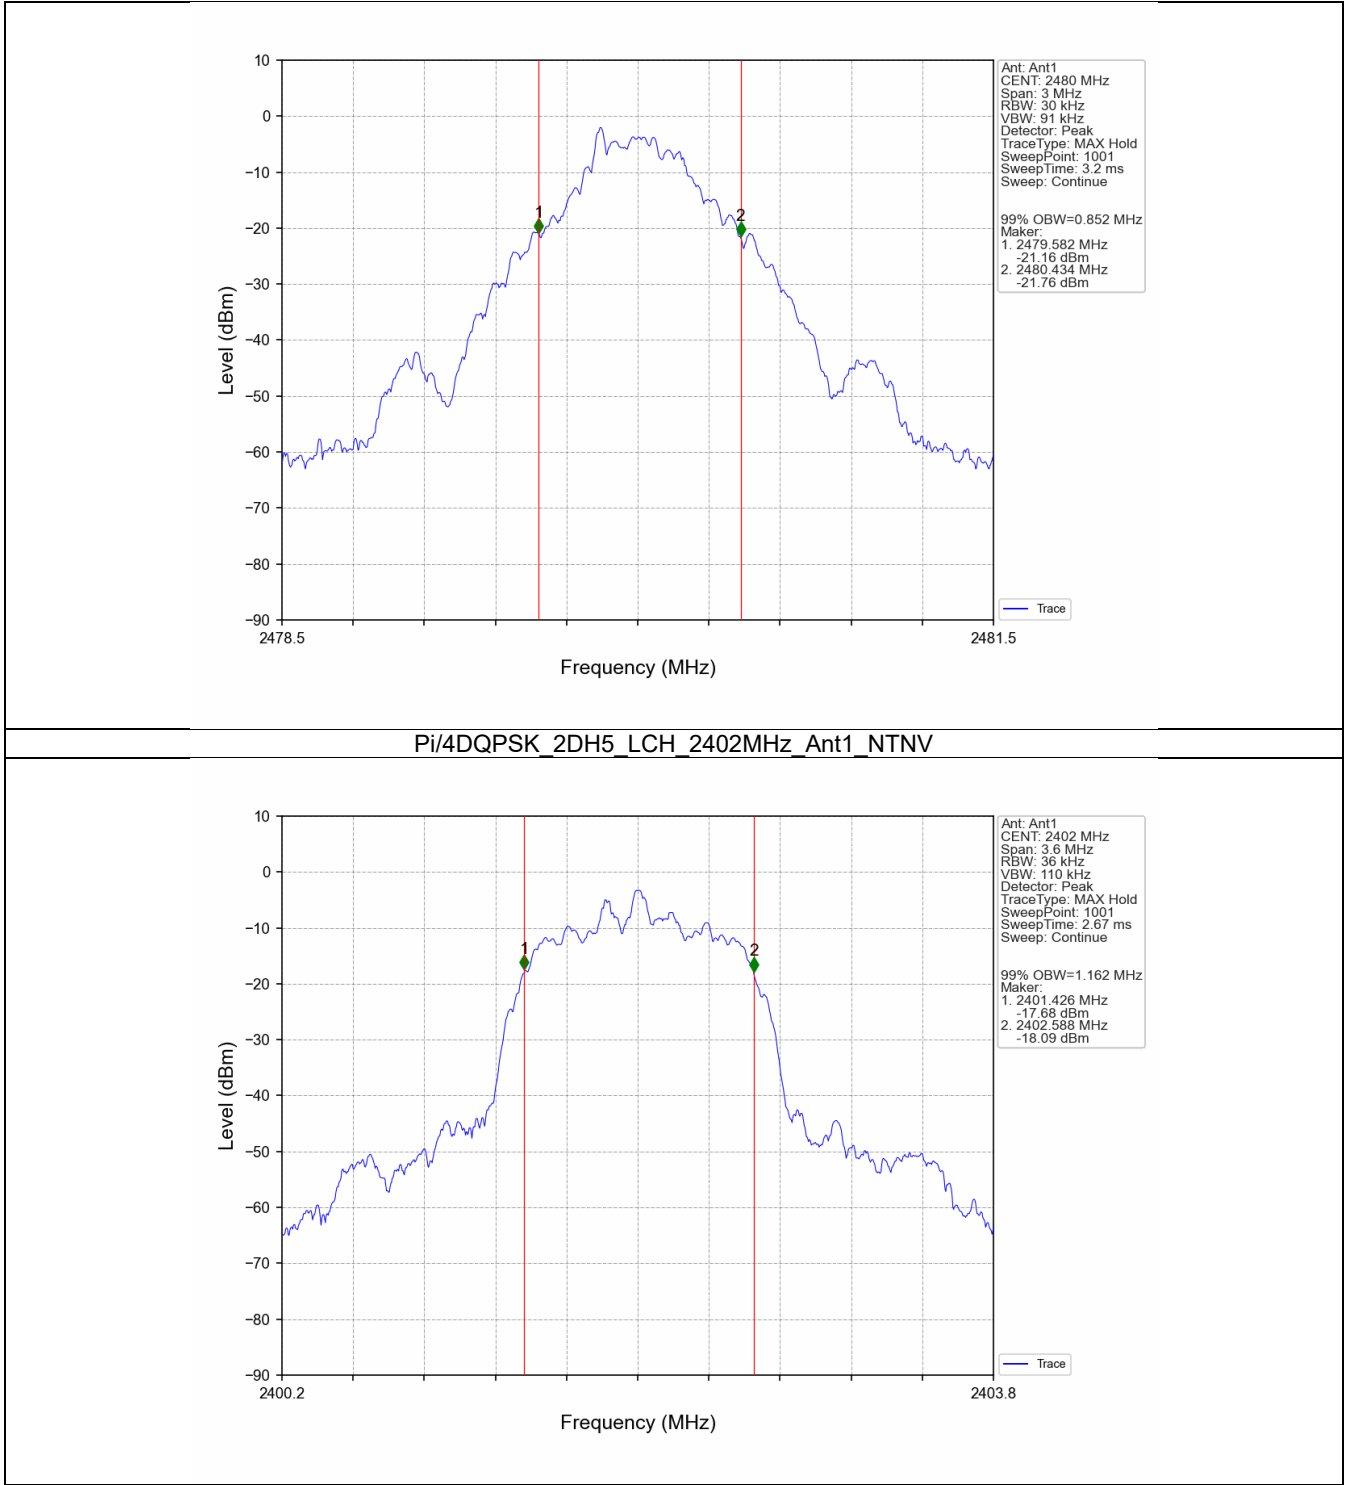


FCC ID: 2BDUR-1202260

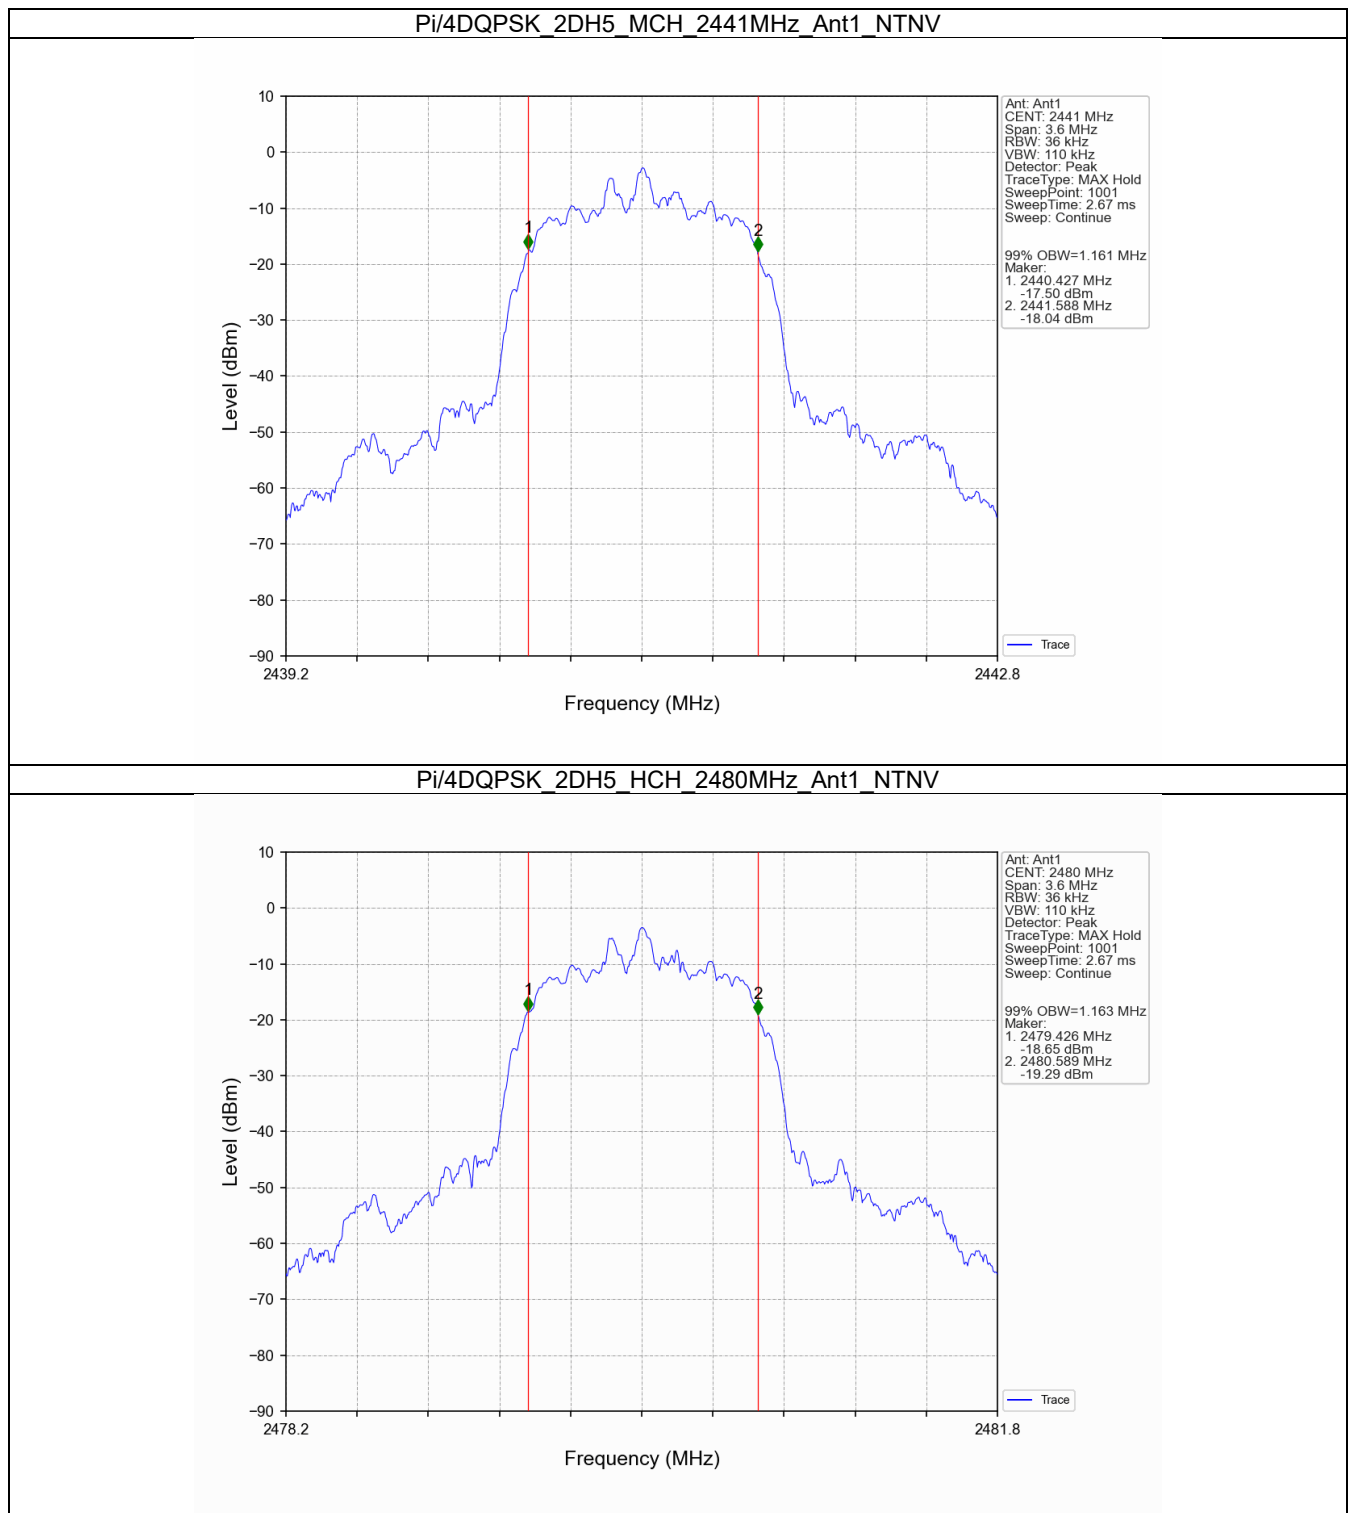

FCC ID: 2BDUR-1202260

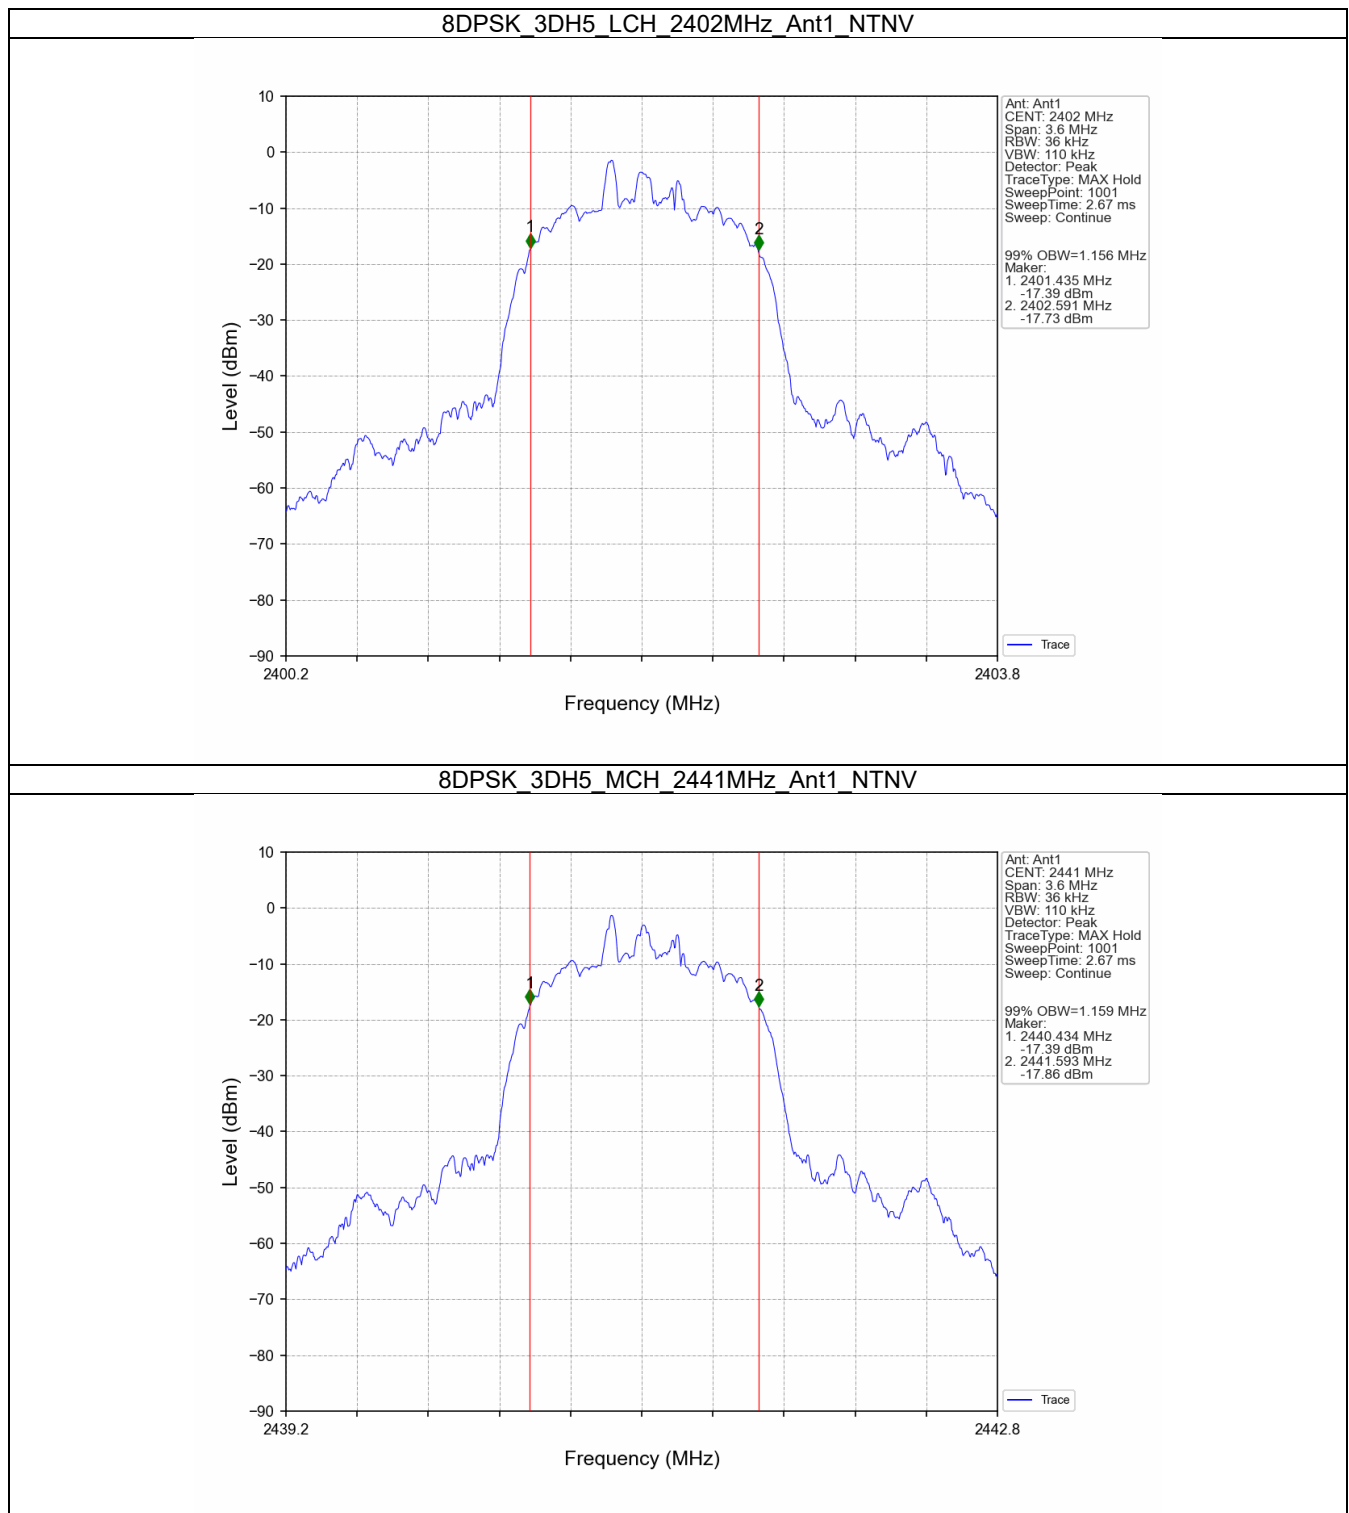


FCC ID: 2BDUR-1202260

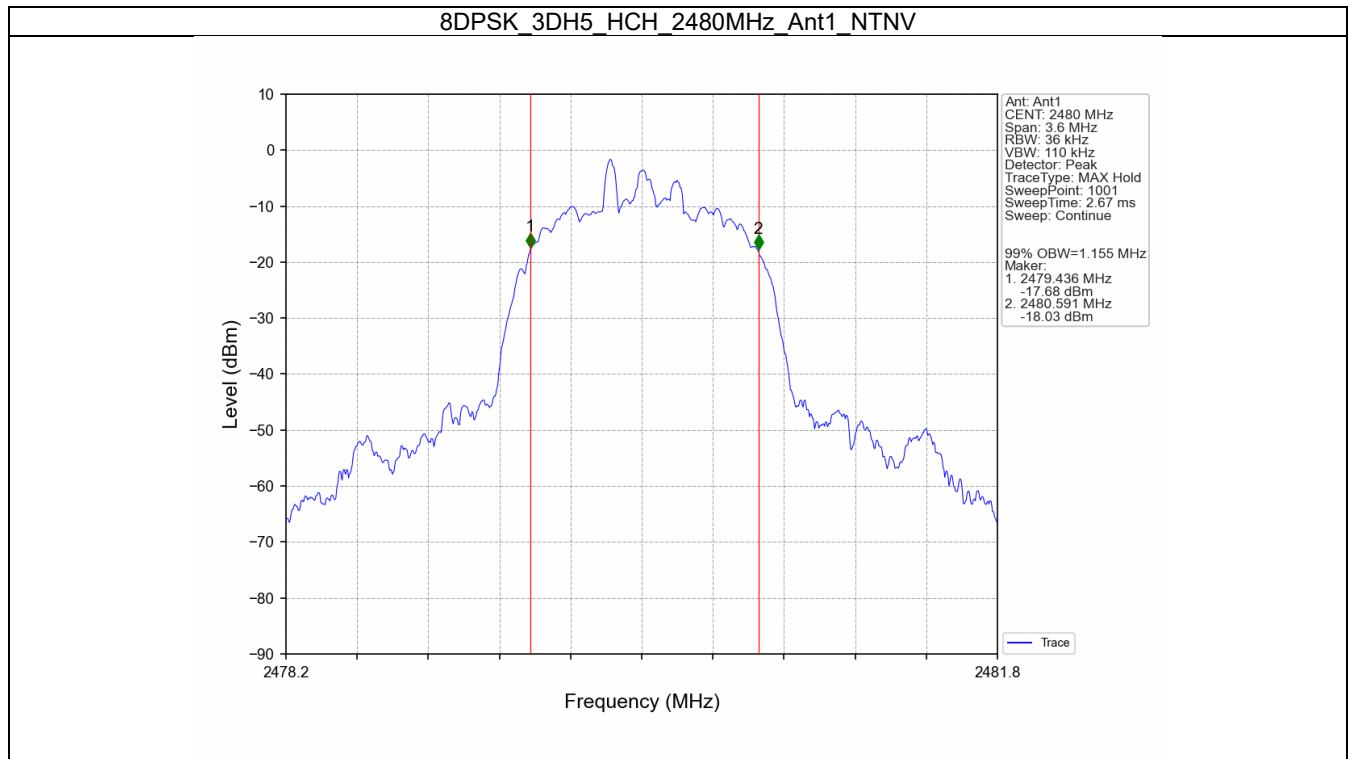


FCC ID: 2BDUR-1202260


1.2.2 20dB BW

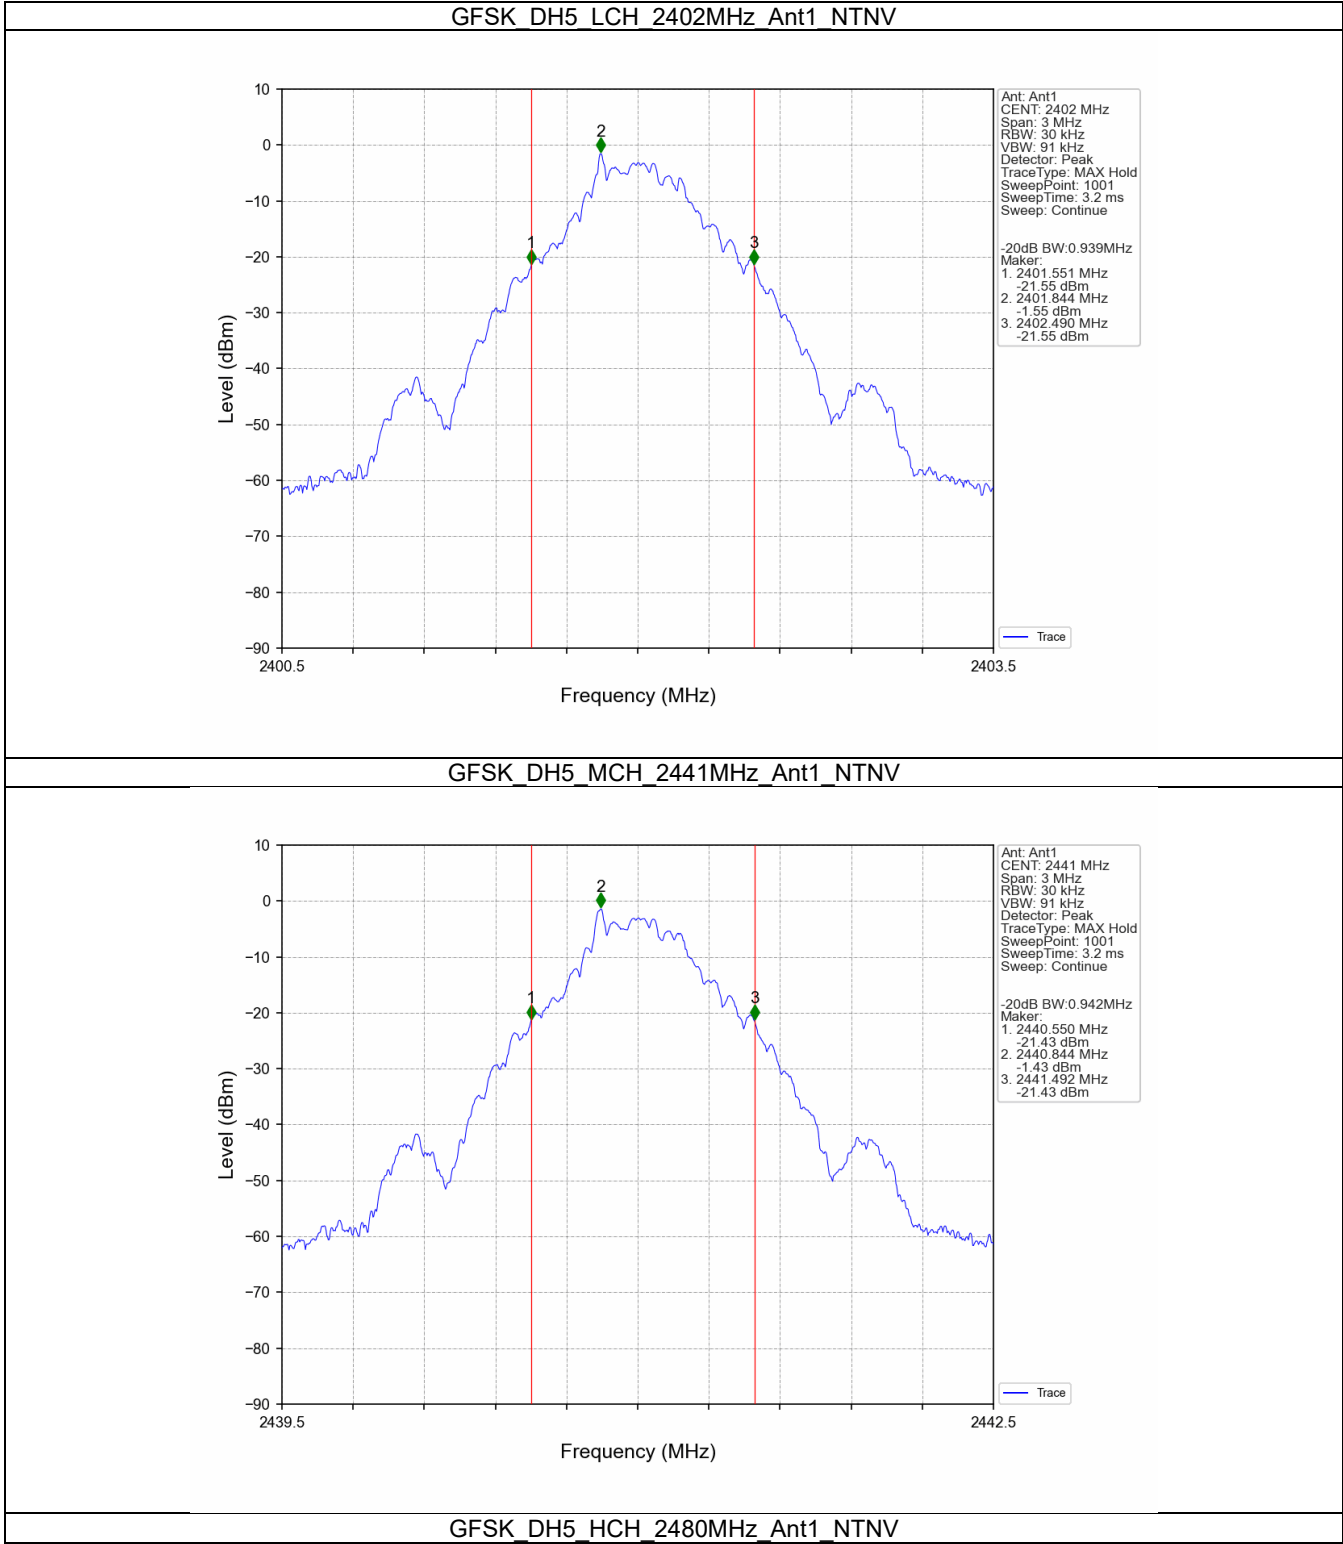


FCC ID: 2BDUR-1202260

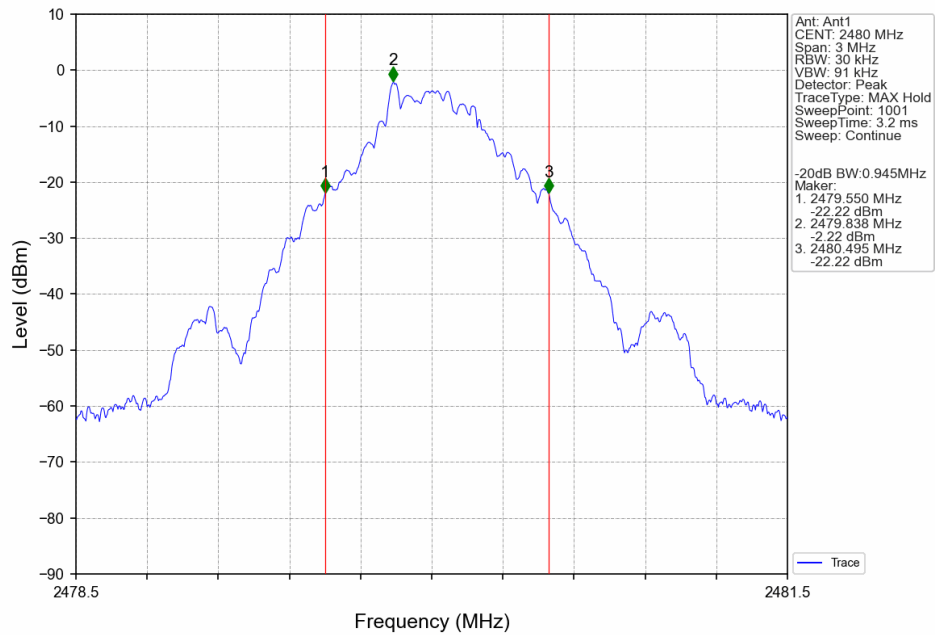

Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

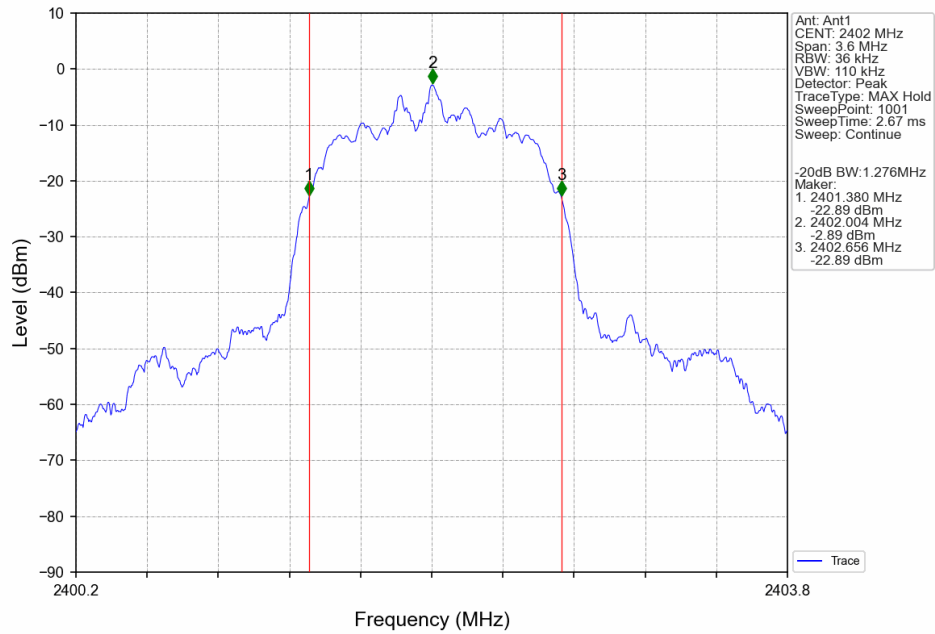


FCC ID: 2BDUR-1202260

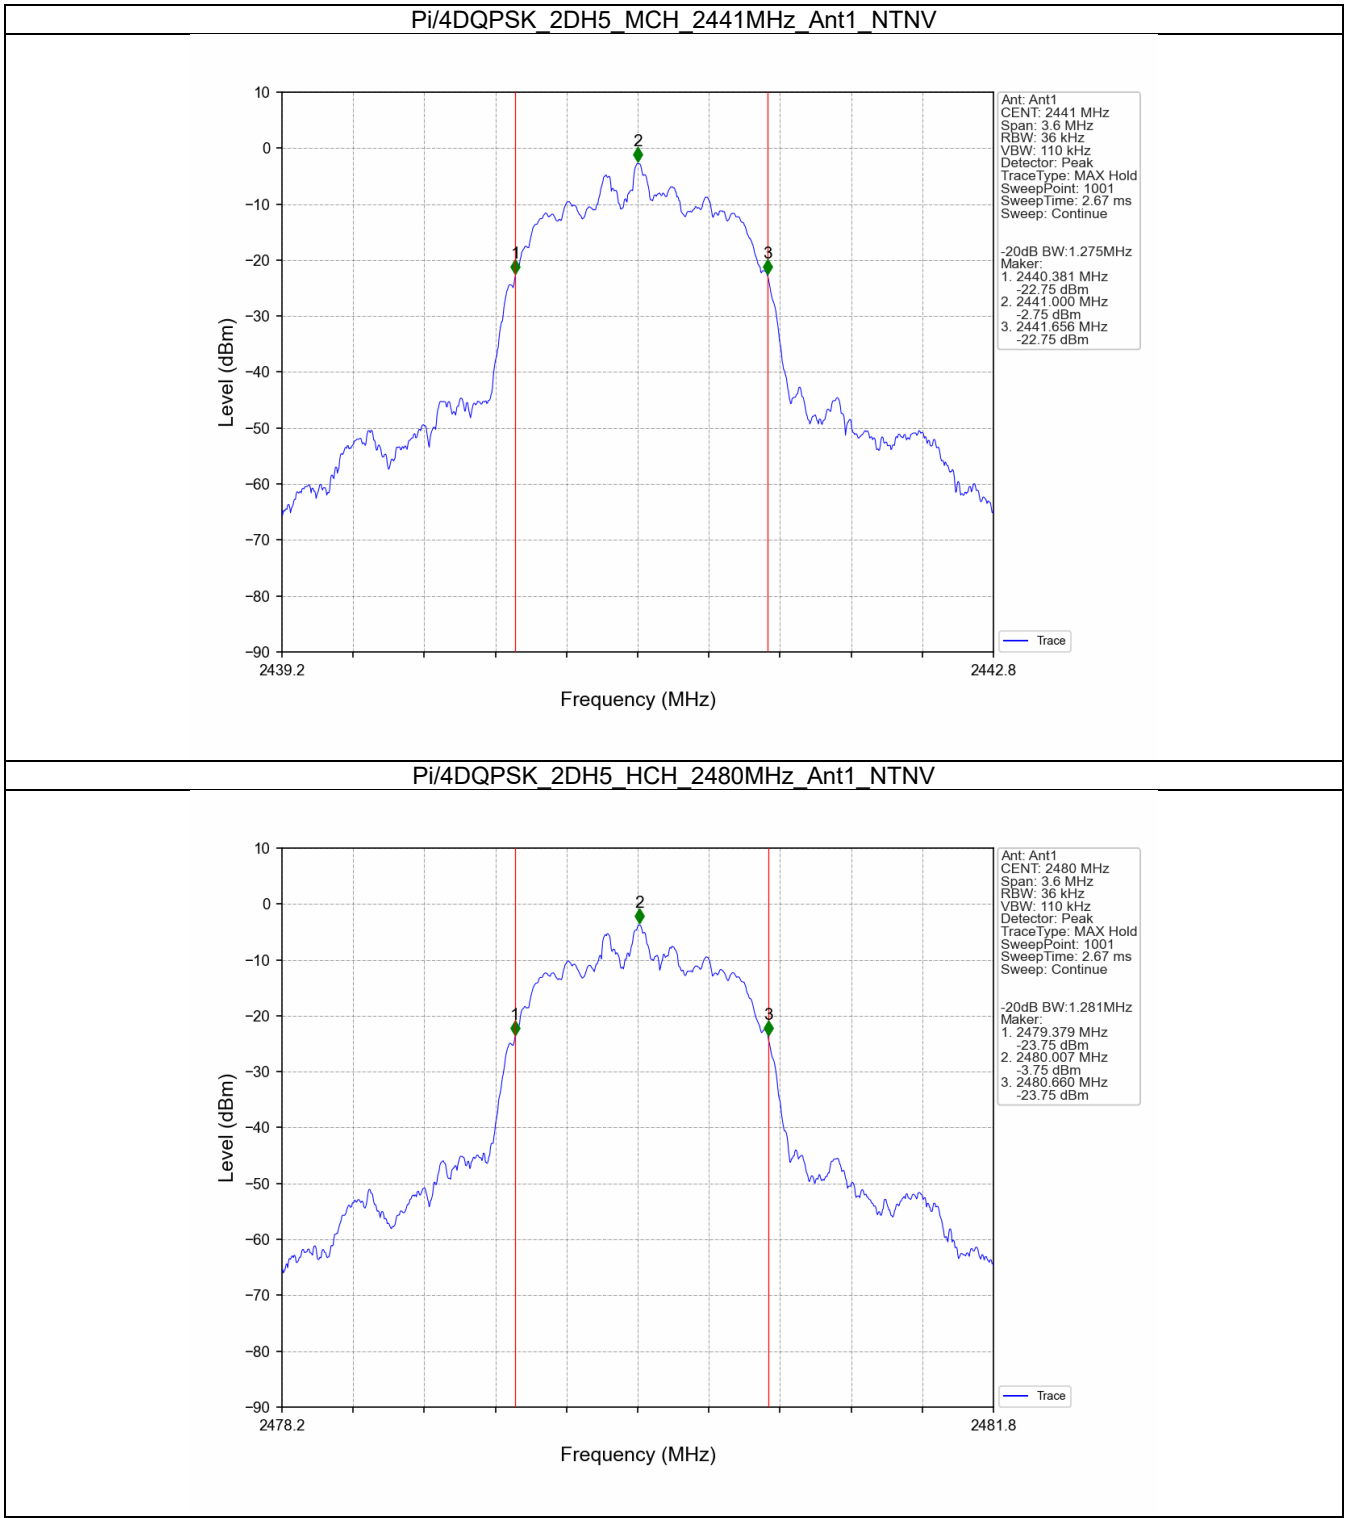


FCC ID: 2BDUR-1202260


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

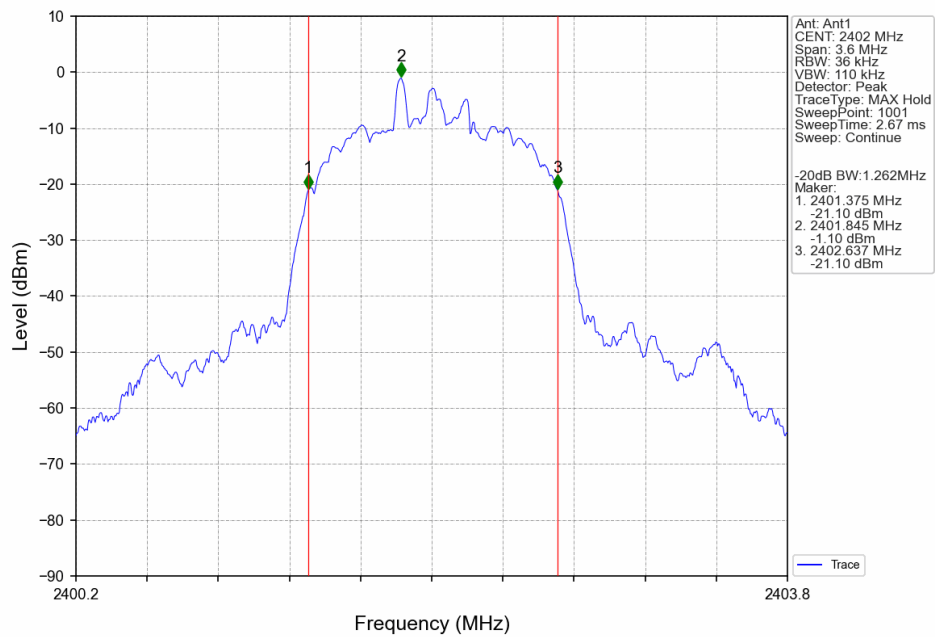

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

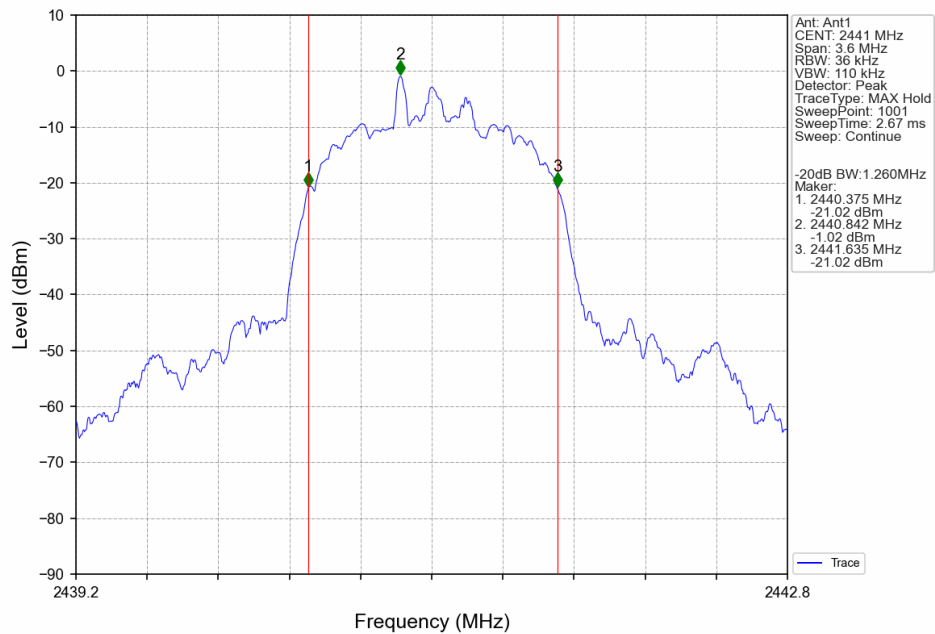

FCC ID: 2BDUR-1202260

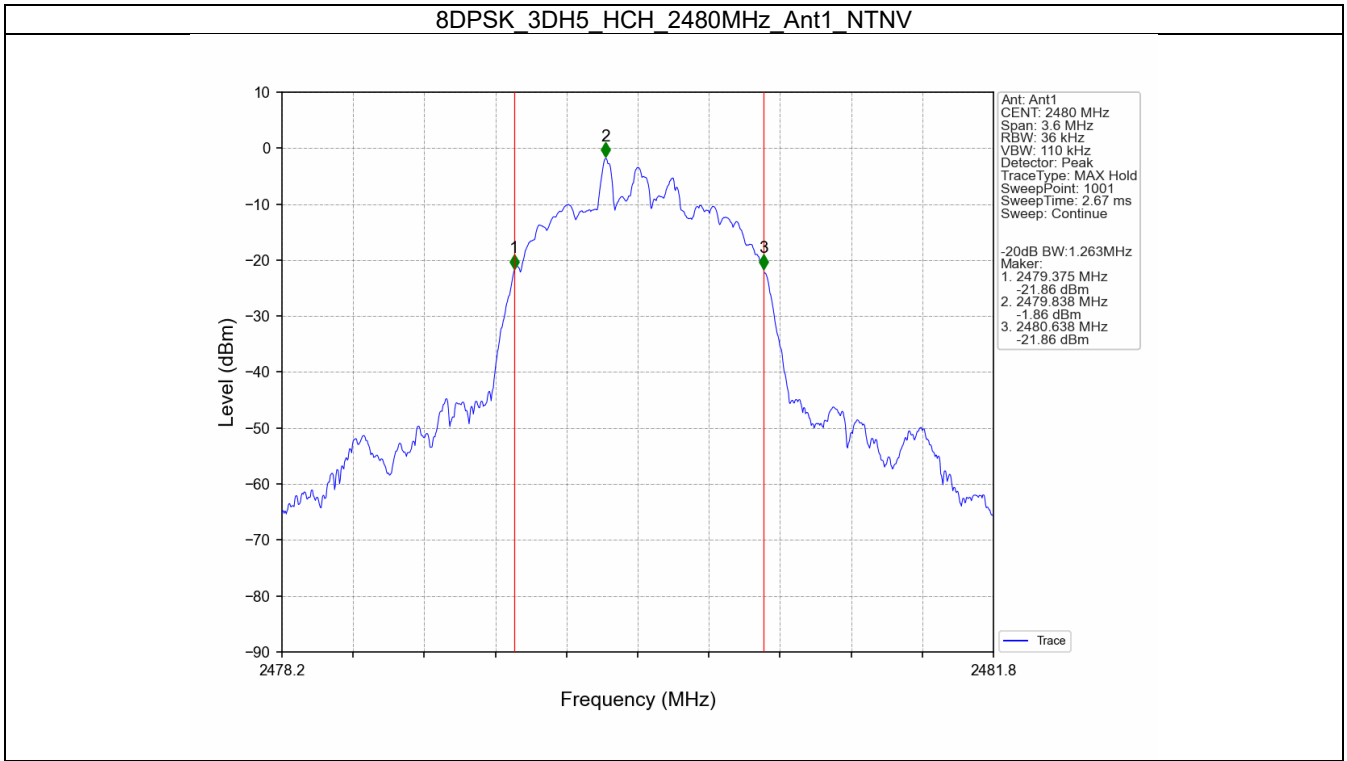

FCC ID: 2BDUR-1202260

2. Maximum Conducted Output Power

2.1 Test Result


2.1.1 Power

Mode	TX Type	Frequency (MHz)	Packet Type	Maximum Peak Conducted Output Power (dBm)		Verdict
				ANT1	Limit	
GFSK	SISO	2402	DH5	-0.67	<=30	Pass
		2441	DH5	-0.54	<=30	Pass
		2480	DH5	-1.17	<=30	Pass
Pi/4DQPSK	SISO	2402	2DH5	-0.68	<=20.97	Pass
		2441	2DH5	-0.53	<=20.97	Pass
		2480	2DH5	-1.17	<=20.97	Pass
8DPSK	SISO	2402	3DH5	-1.84	<=20.97	Pass
		2441	3DH5	-0.43	<=20.97	Pass
		2480	3DH5	-1.07	<=20.97	Pass
Note1: Antenna Gain: Ant1: 2.00dBi;						


FCC ID: 2BDUR-1202260

2.2 Test Graph


2.2.1 Power

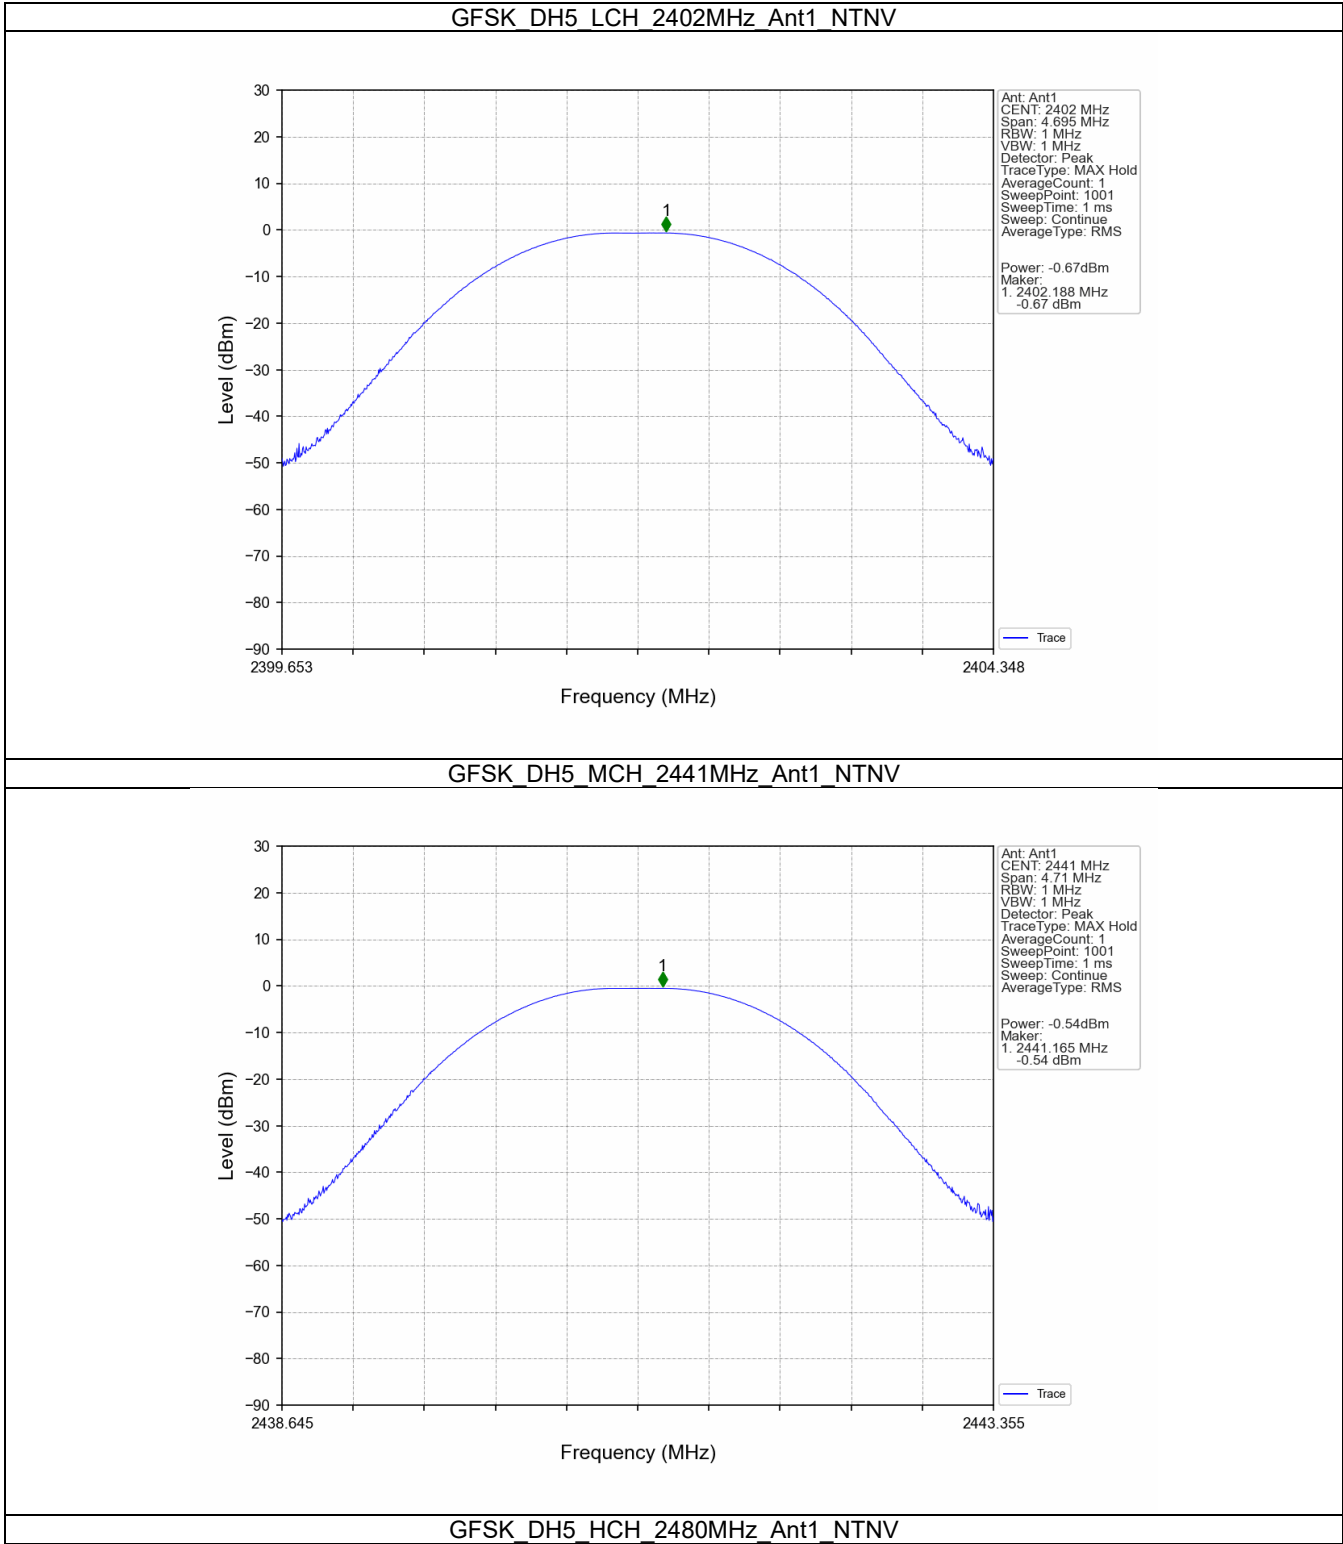


FCC ID: 2BDUR-1202260

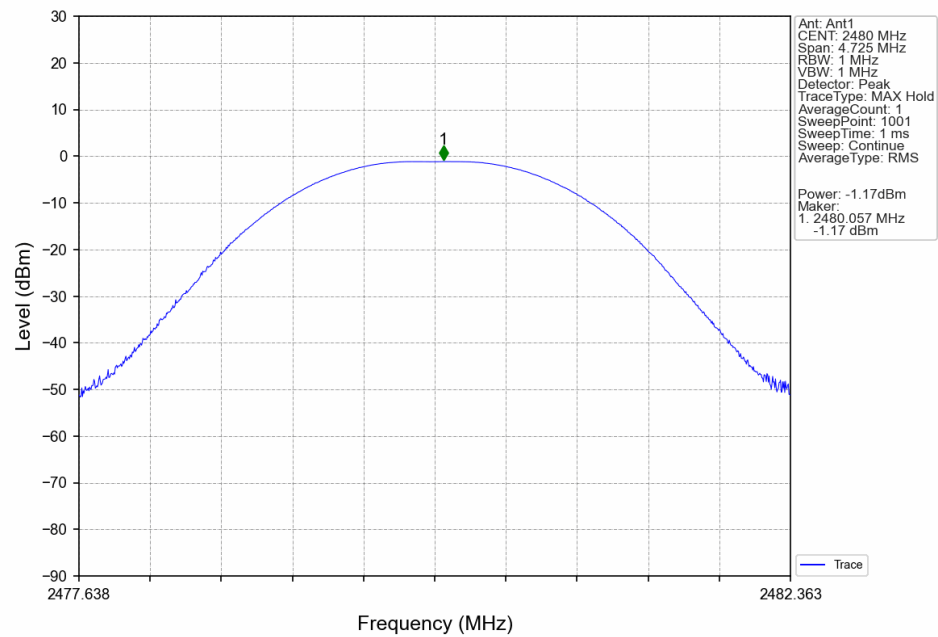

Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

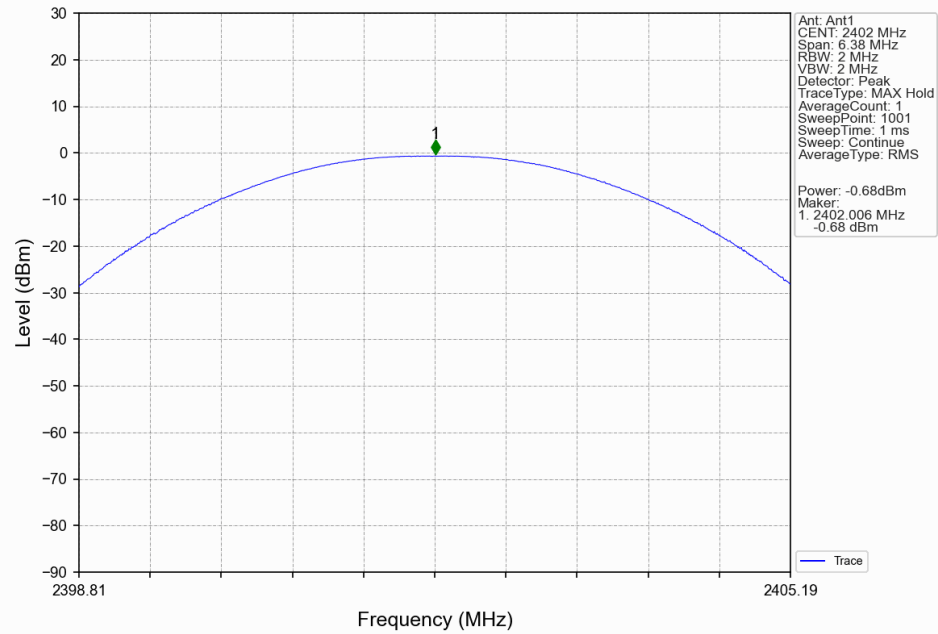


FCC ID: 2BDUR-1202260

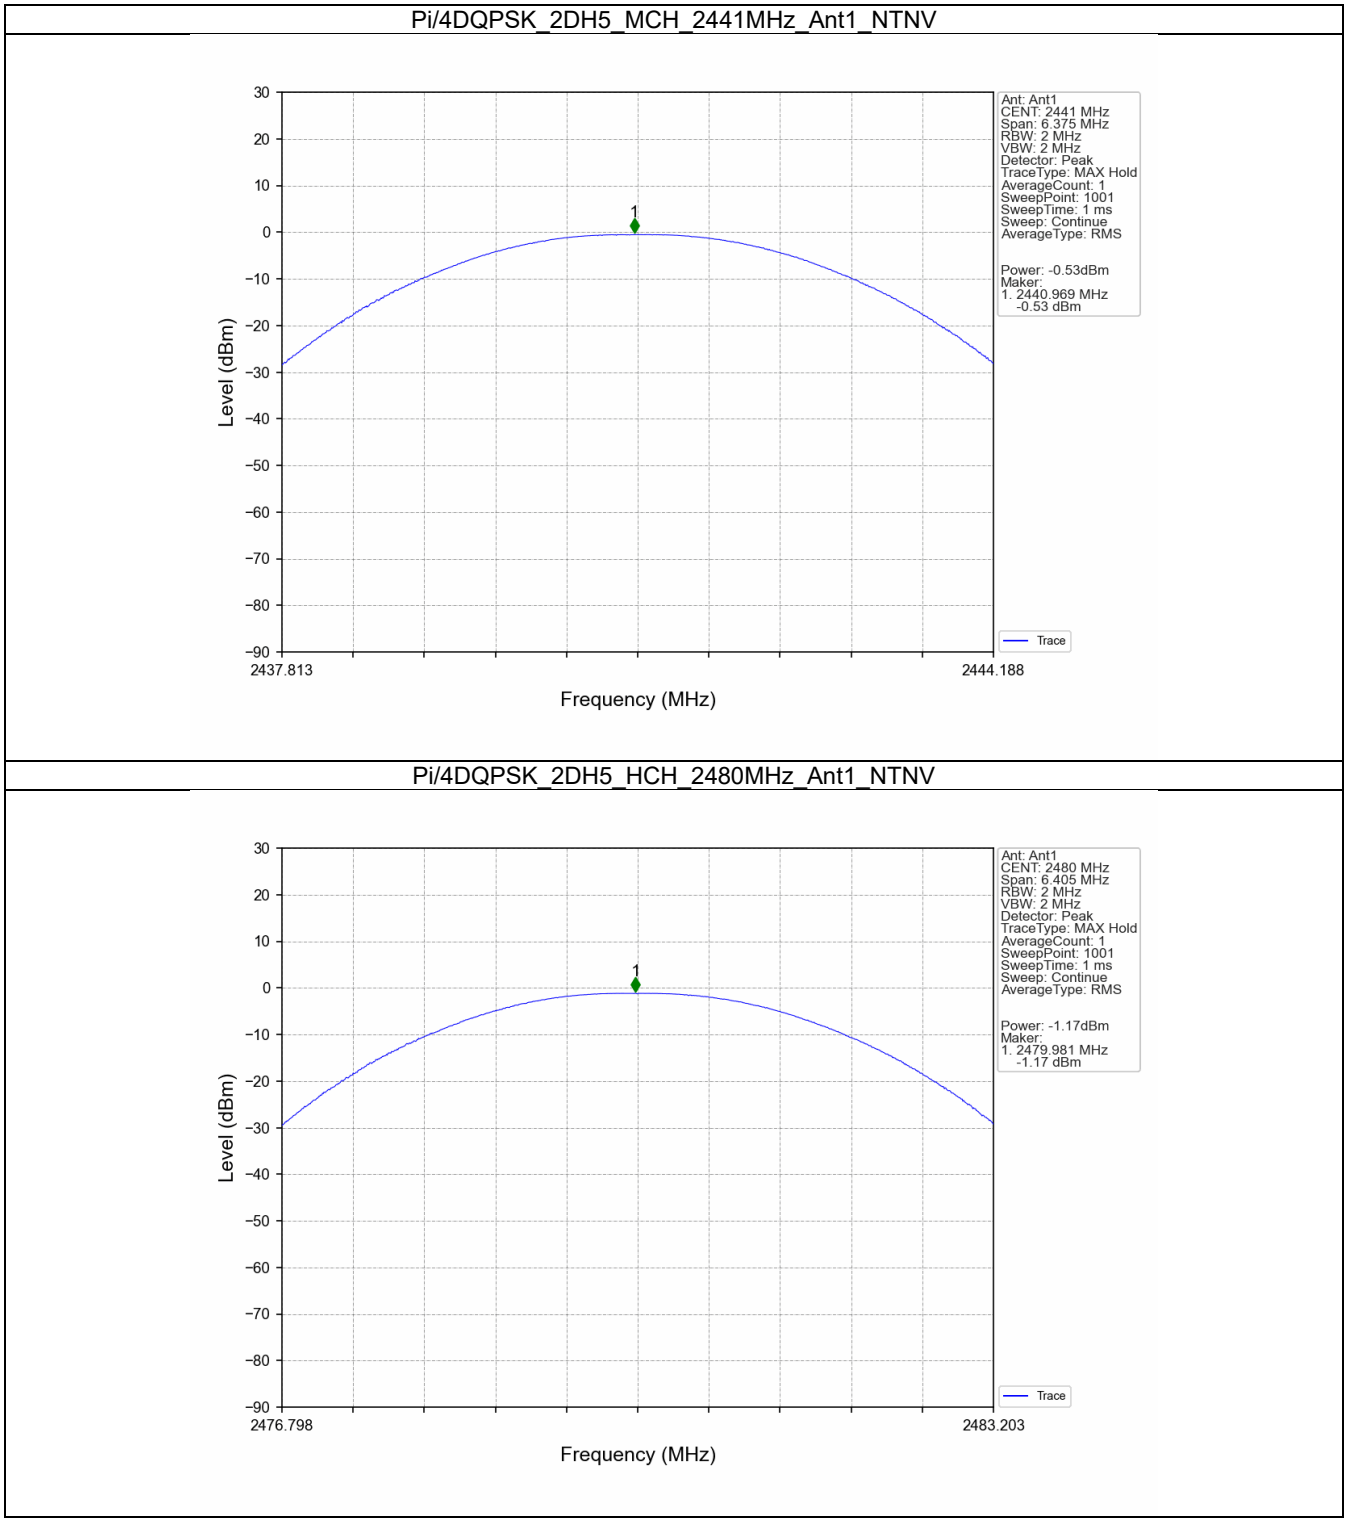


FCC ID: 2BDUR-1202260


8DPSK_3DH5_LCH_2402MHz_Ant1_NTNV

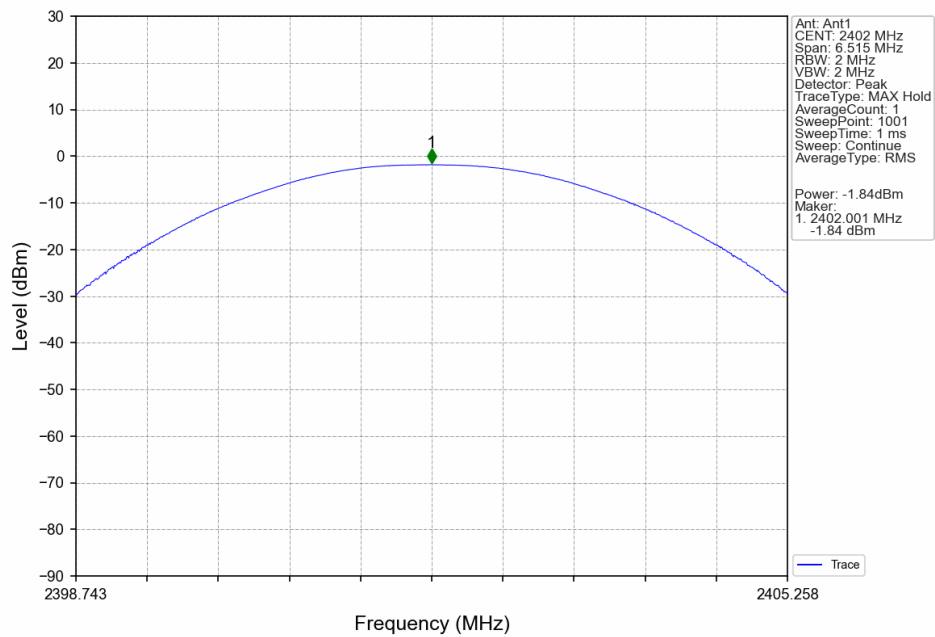

8DPSK_3DH5_MCH_2441MHz_Ant1_NTNV

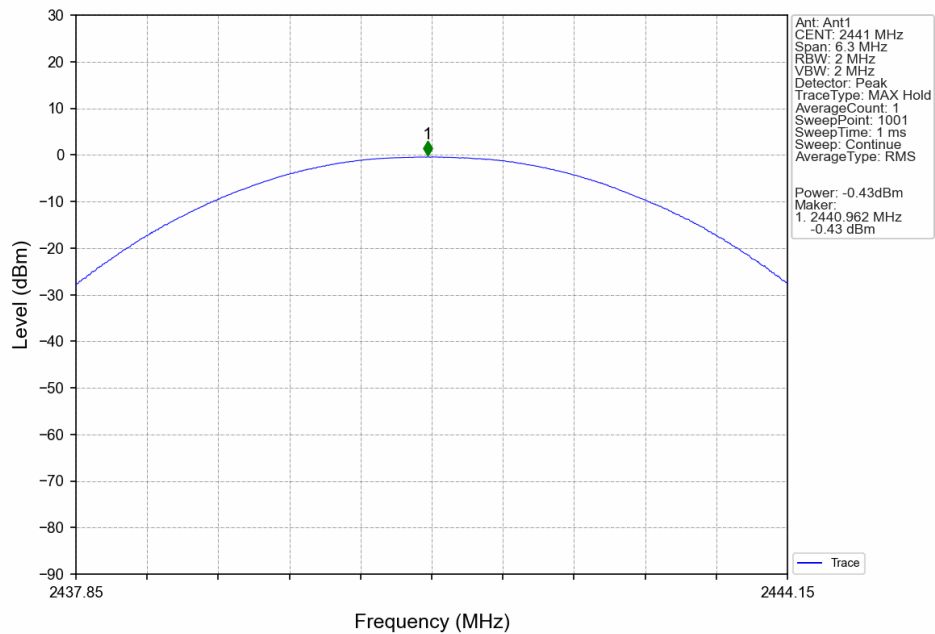

FCC ID: 2BDUR-1202260

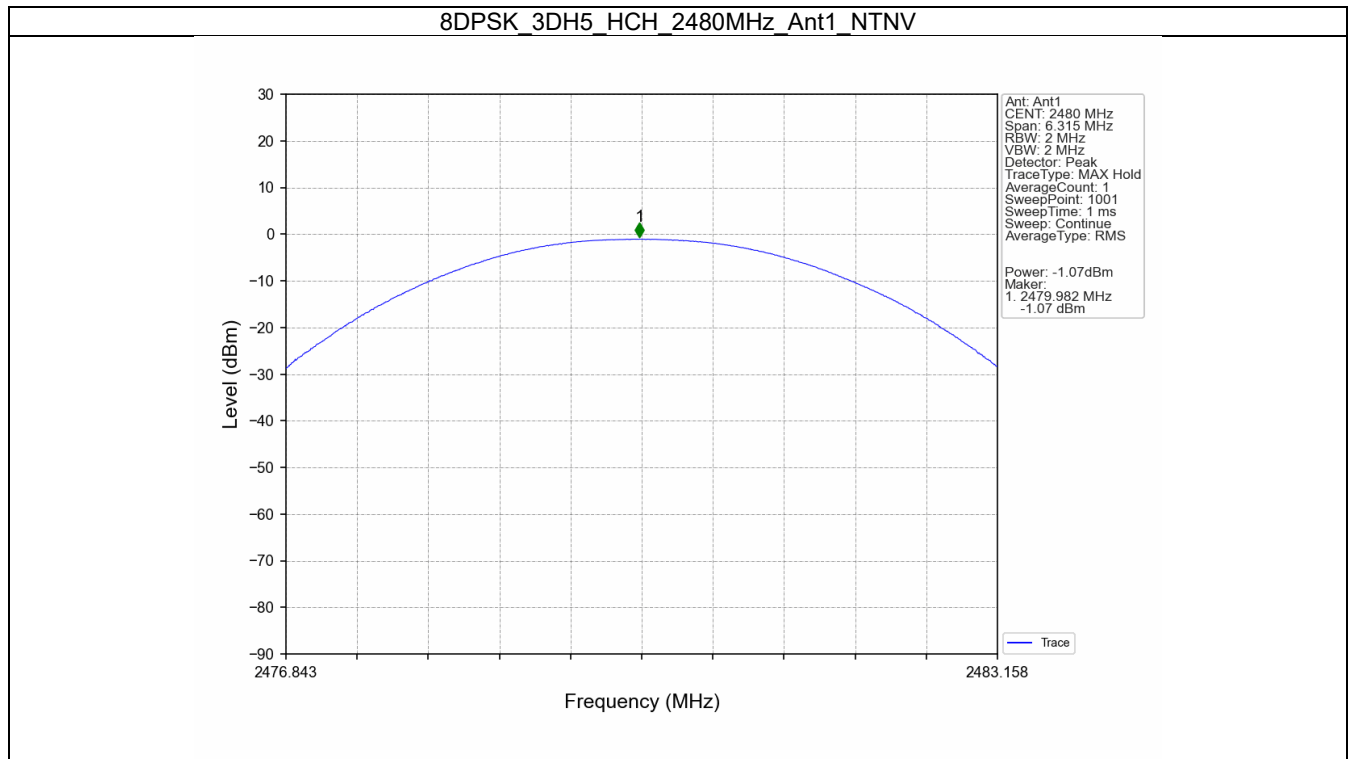

FCC ID: 2BDUR-1202260

3. Carrier Frequency Separation

3.1 Test Result


3.1.1 Ant1

Ant1							
Mode	TX Type	Frequency (MHz)	Packet Type	Channel Separation (MHz)	20dB Bandwidth (MHz)	Limit (MHz)	Verdict
GFSK	SISO	HOPP	DH5	1.006	0.945	≥ 0.945	Pass
Pi/4DQPSK	SISO	HOPP	2DH5	0.998	1.281	≥ 0.854	Pass
8DPSK	SISO	HOPP	3DH5	1.001	1.263	≥ 0.842	Pass


FCC ID: 2BDUR-1202260

3.2 Test Graph

3.2.1 Ant1

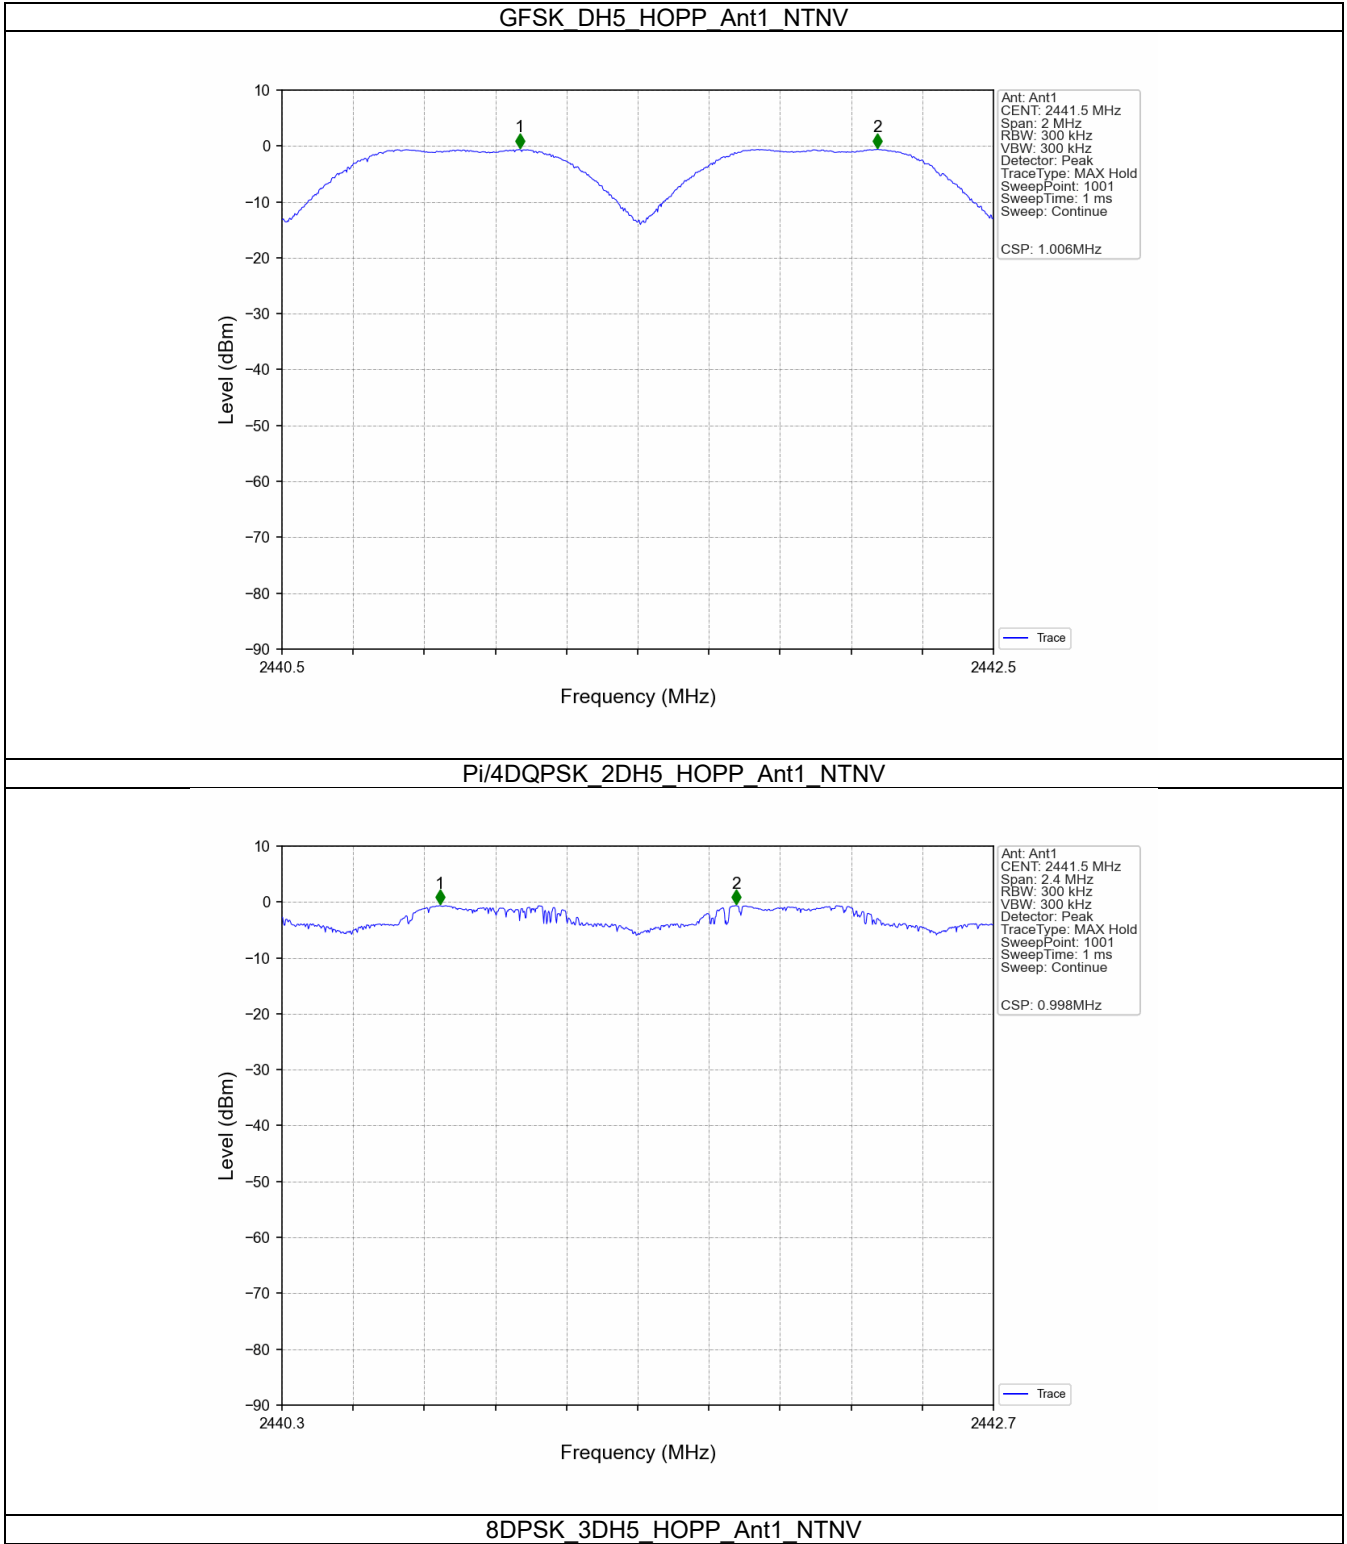

FCC ID: 2BDUR-1202260

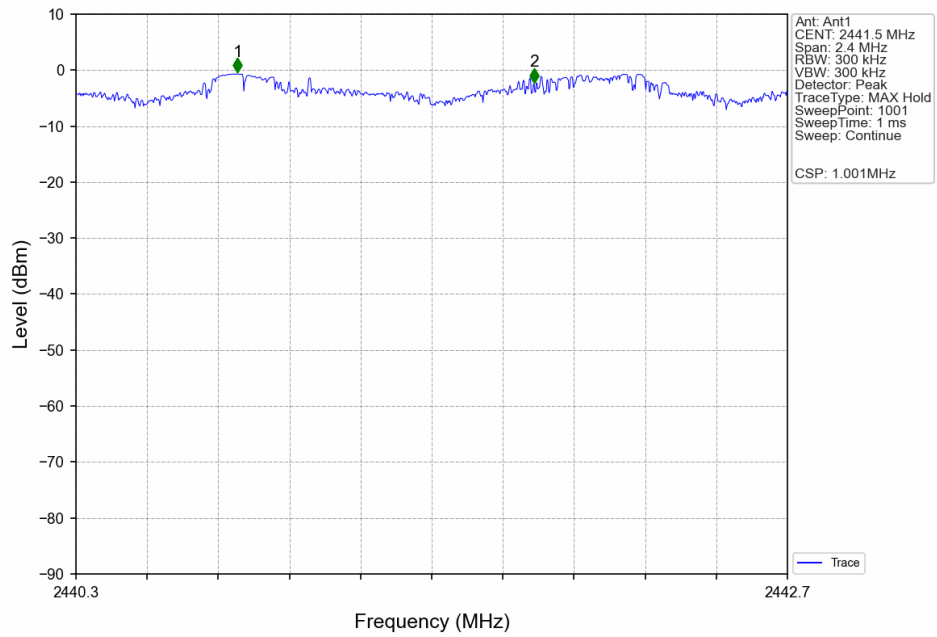

FCC ID: 2BDUR-1202260

4. Number of Hopping Frequencies

4.1 Test Result


4.1.1 HoppNum

Mode	TX Type	Frequency (MHz)	Packet Type	Num of Hopping Frequencies		Verdict
				ANT1	Limit	
GFSK	SISO	HOPP	DH5	79	>=15	Pass
Pi/4DQPSK	SISO	HOPP	2DH5	79	>=15	Pass
8DPSK	SISO	HOPP	3DH5	79	>=15	Pass


FCC ID: 2BDUR-1202260

4.2 Test Graph

4.2.1 HoppNum

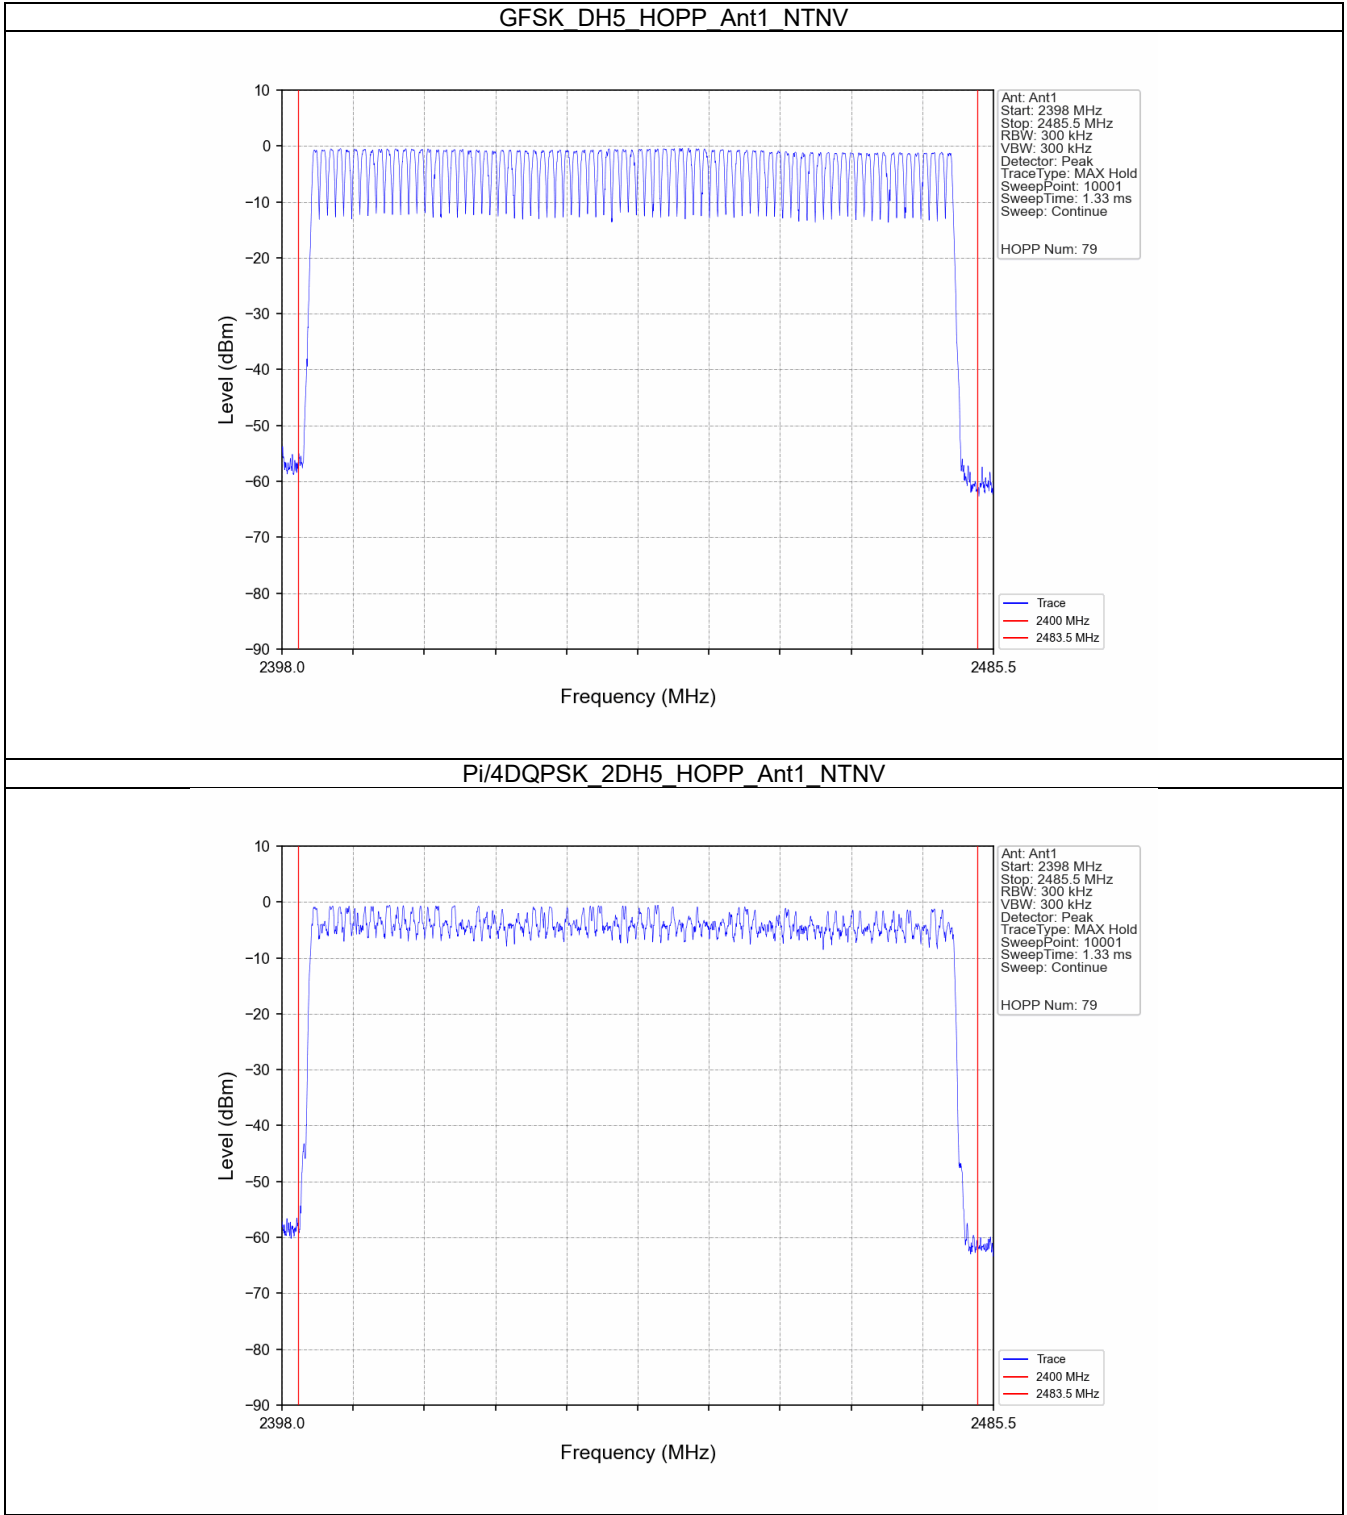

FCC ID: 2BDUR-1202260

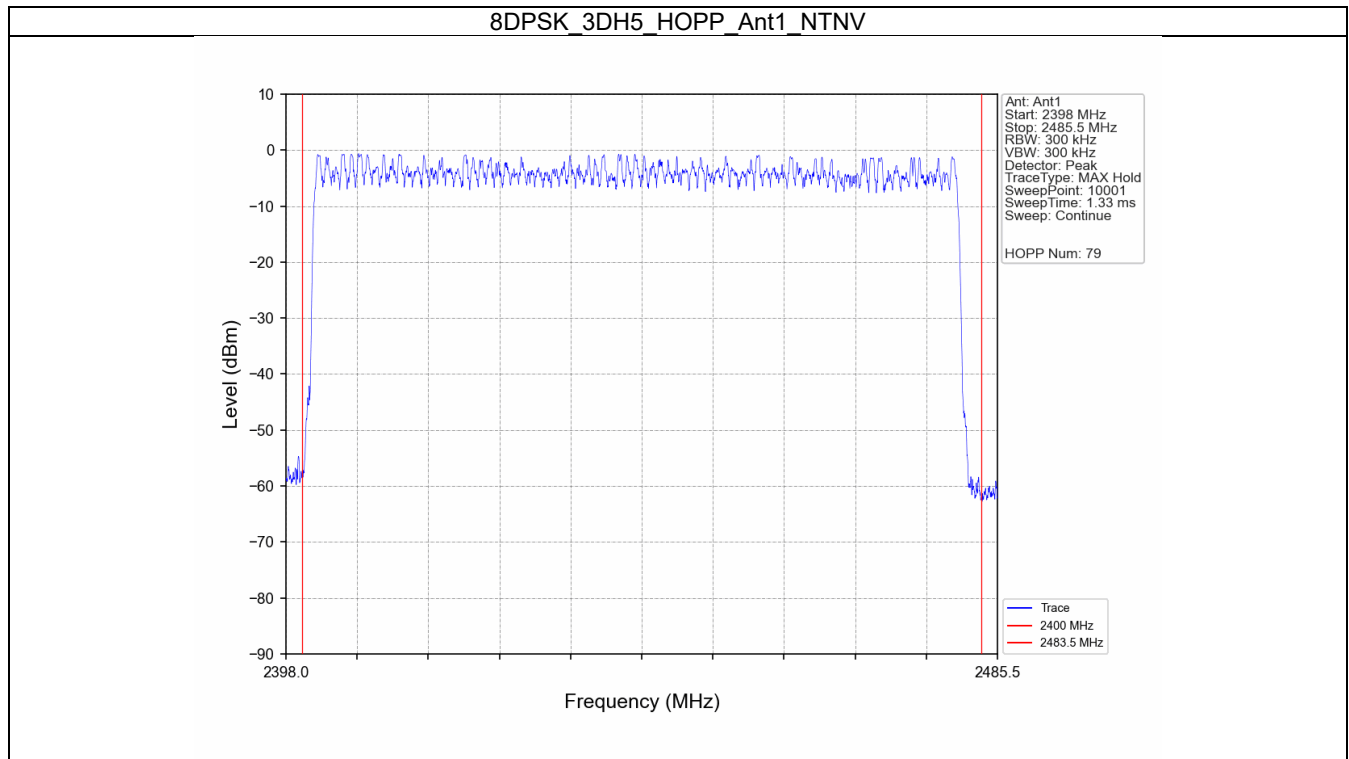

FCC ID: 2BDUR-1202260


5. Time of Occupancy (Dwell Time)**5.1 Test Result****5.1.1 Ant1**

Ant1									
Mode	Tx Type	Frequency (MHz)	Packet Type	Duration of Single Pulse (ms)	Observation Period (s)	Num of Pulse in Observation Period	Dwell Time (ms)	Limit (ms)	Verdict
GFSK	SISO	HOPP	DH1	0.374	31.600	240	89.760	<=400	Pass
			DH3	1.622	31.600	126	204.372	<=400	Pass
			DH5	2.872	31.600	92	264.224	<=400	Pass
Pi/4DQPSK	SISO	HOPP	2DH1	0.382	31.600	240	91.680	<=400	Pass
			2DH3	1.634	31.600	128	209.152	<=400	Pass
			2DH5	2.882	31.600	90	259.380	<=400	Pass
8DPSK	SISO	HOPP	3DH1	0.382	31.600	240	91.680	<=400	Pass
			3DH3	1.632	31.600	128	208.896	<=400	Pass
			3DH5	2.882	31.600	92	265.144	<=400	Pass


FCC ID: 2BDUR-1202260

5.2 Test Graph


5.2.1 Ant1

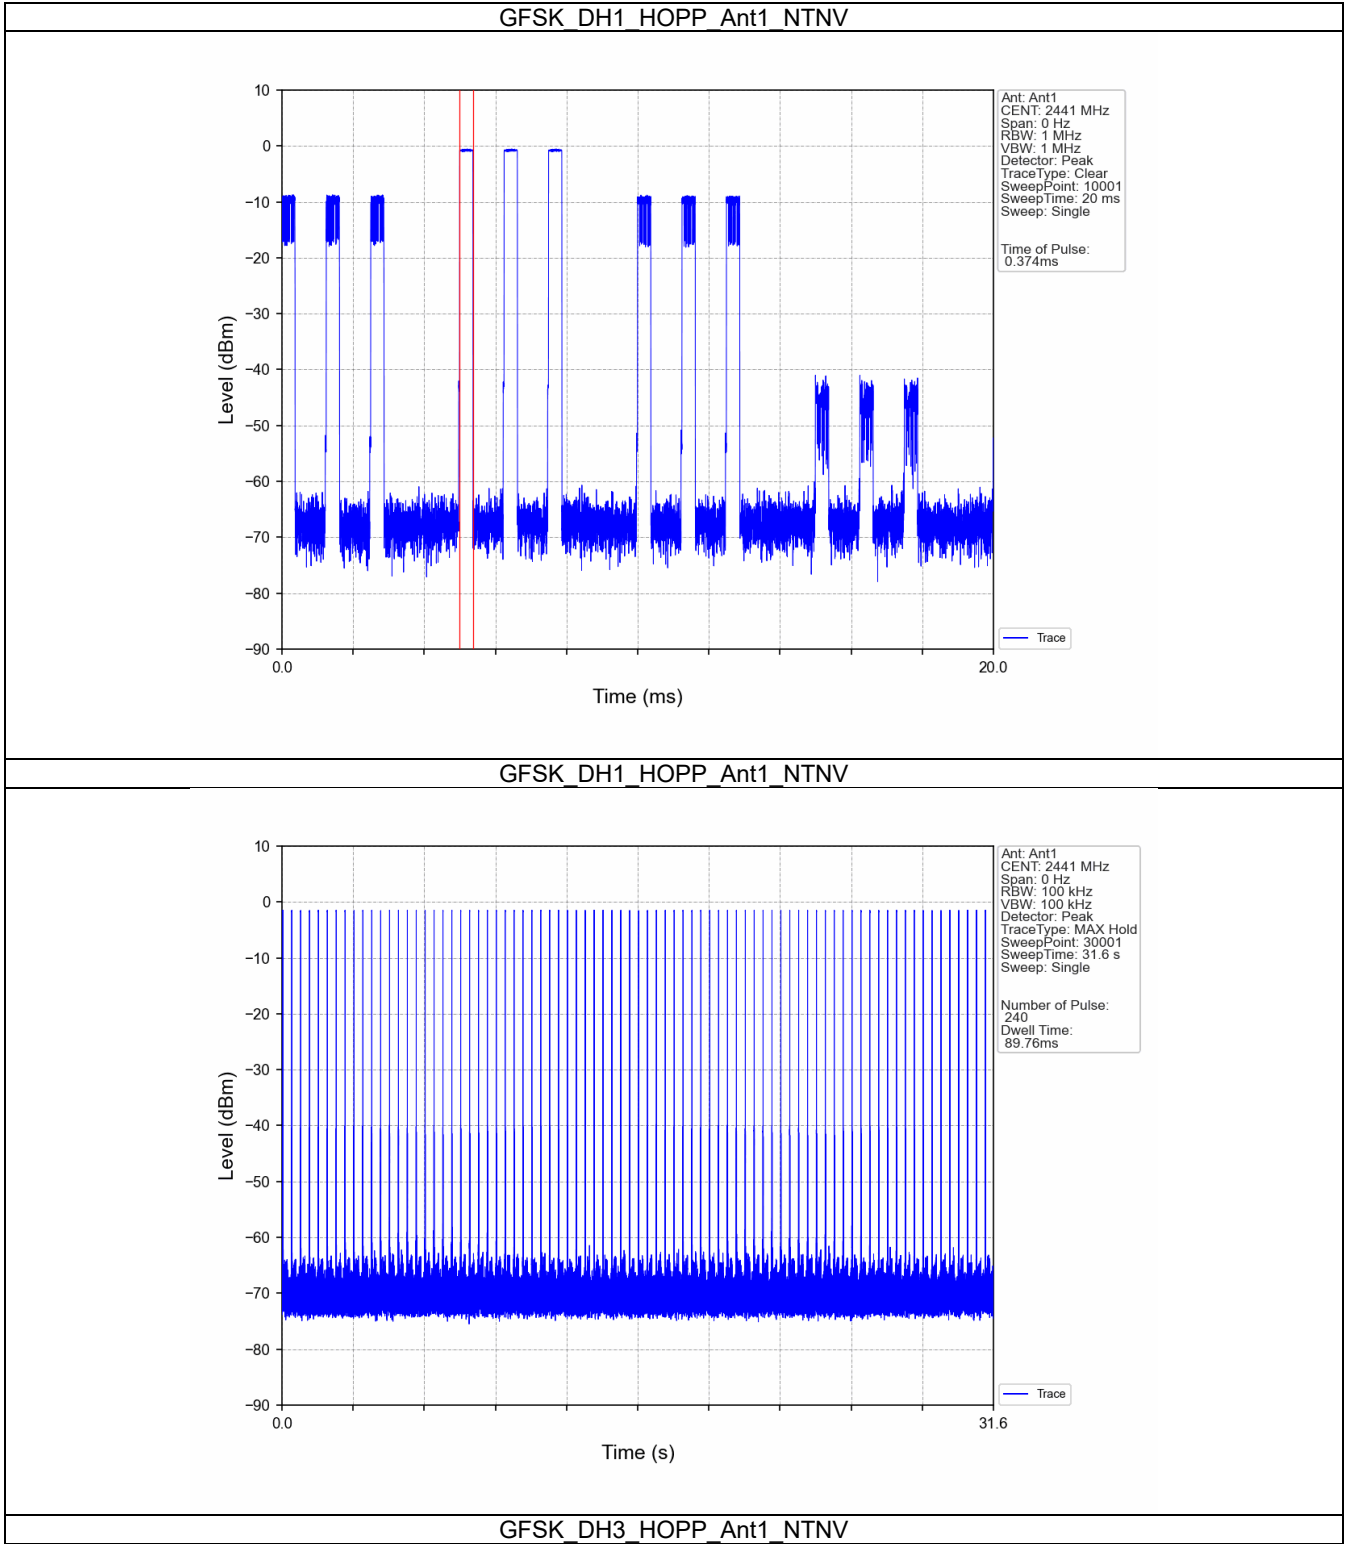


FCC ID: 2BDUR-1202260

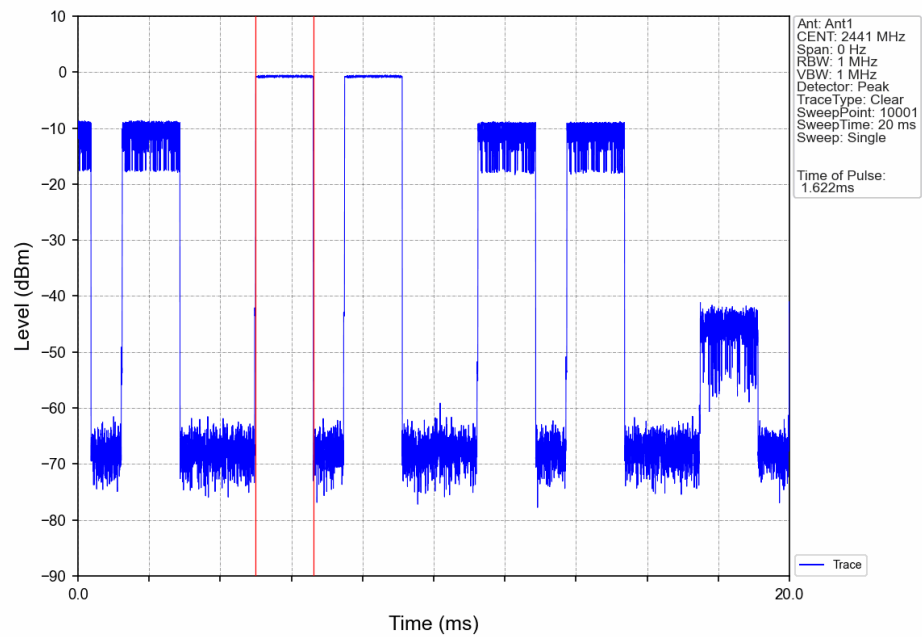


GFSK_DH3_HOPP_Ant1_NTNV

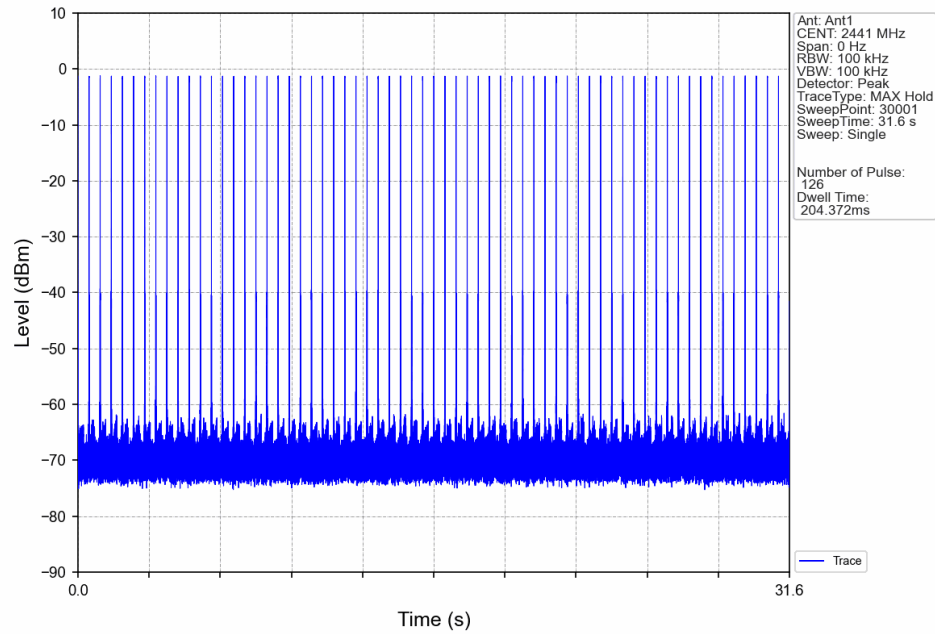


FCC ID: 2BDUR-1202260

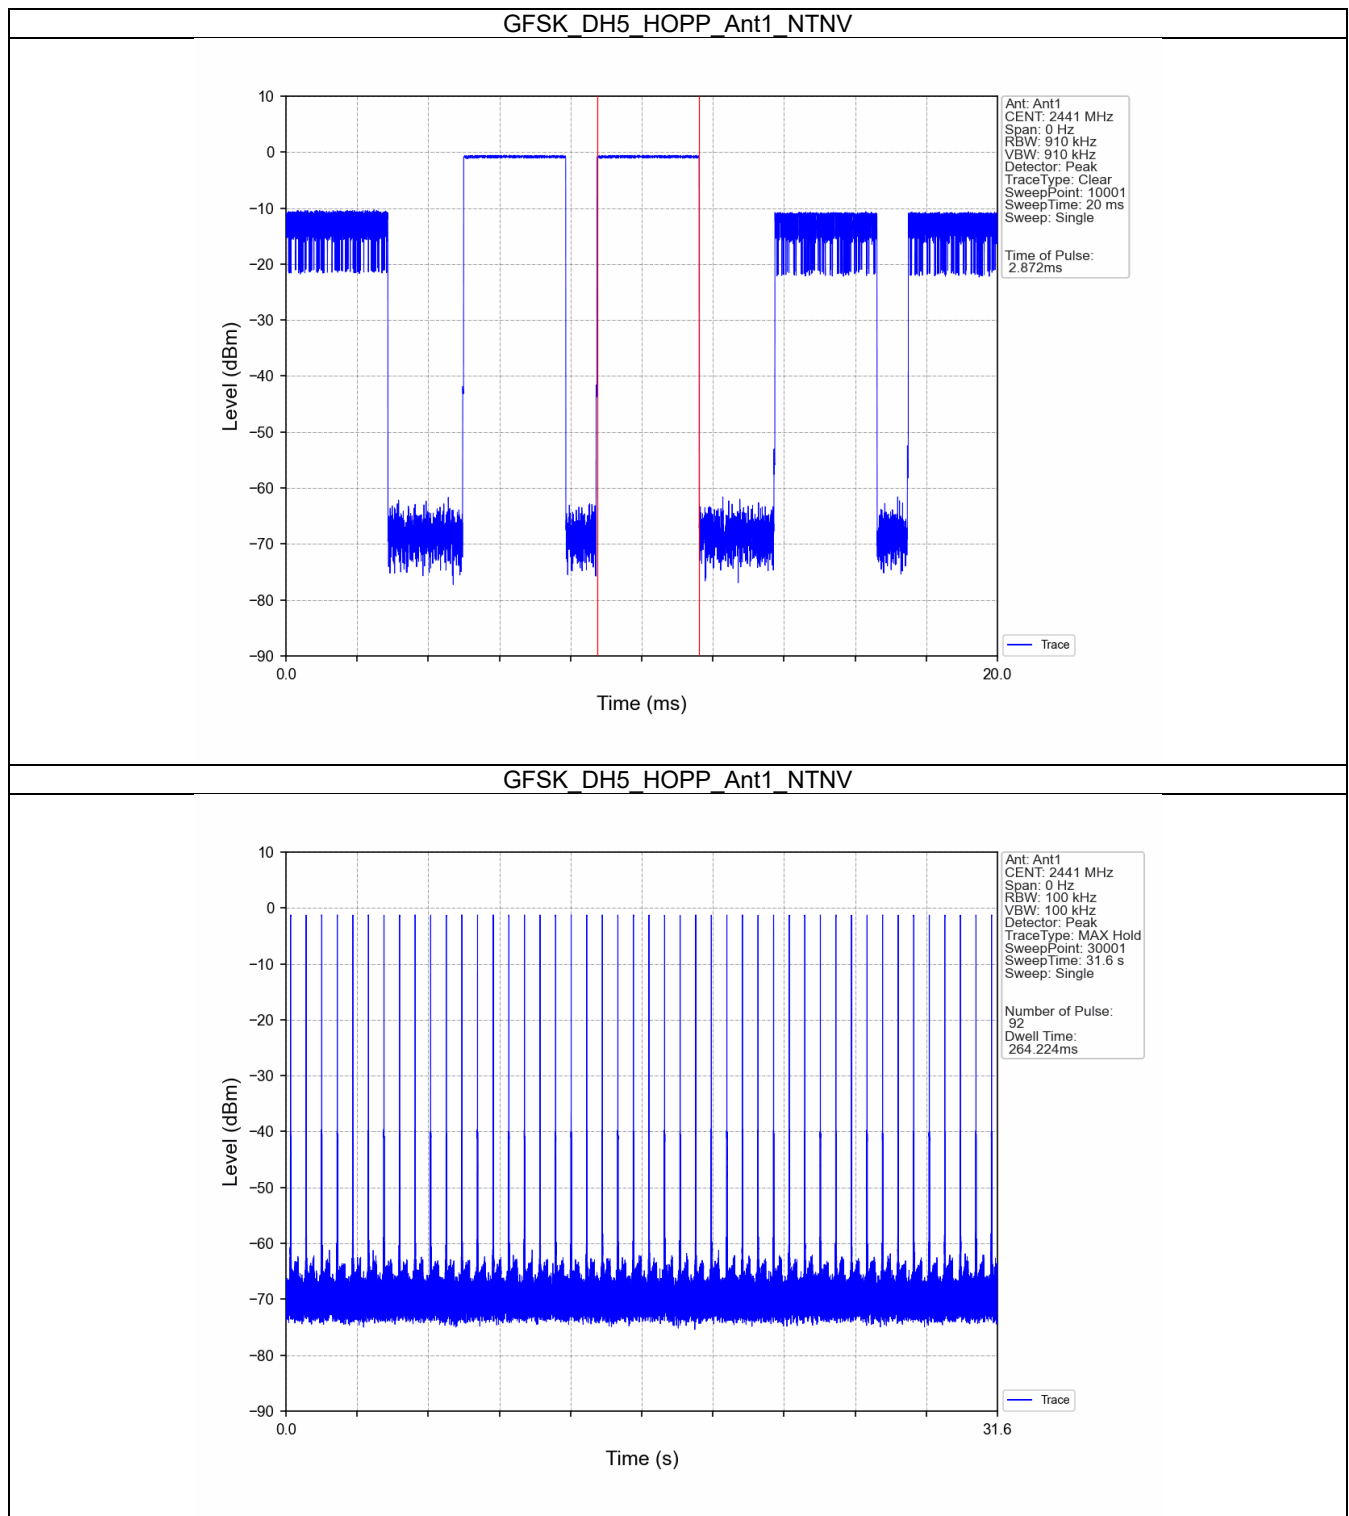


FCC ID: 2BDUR-1202260

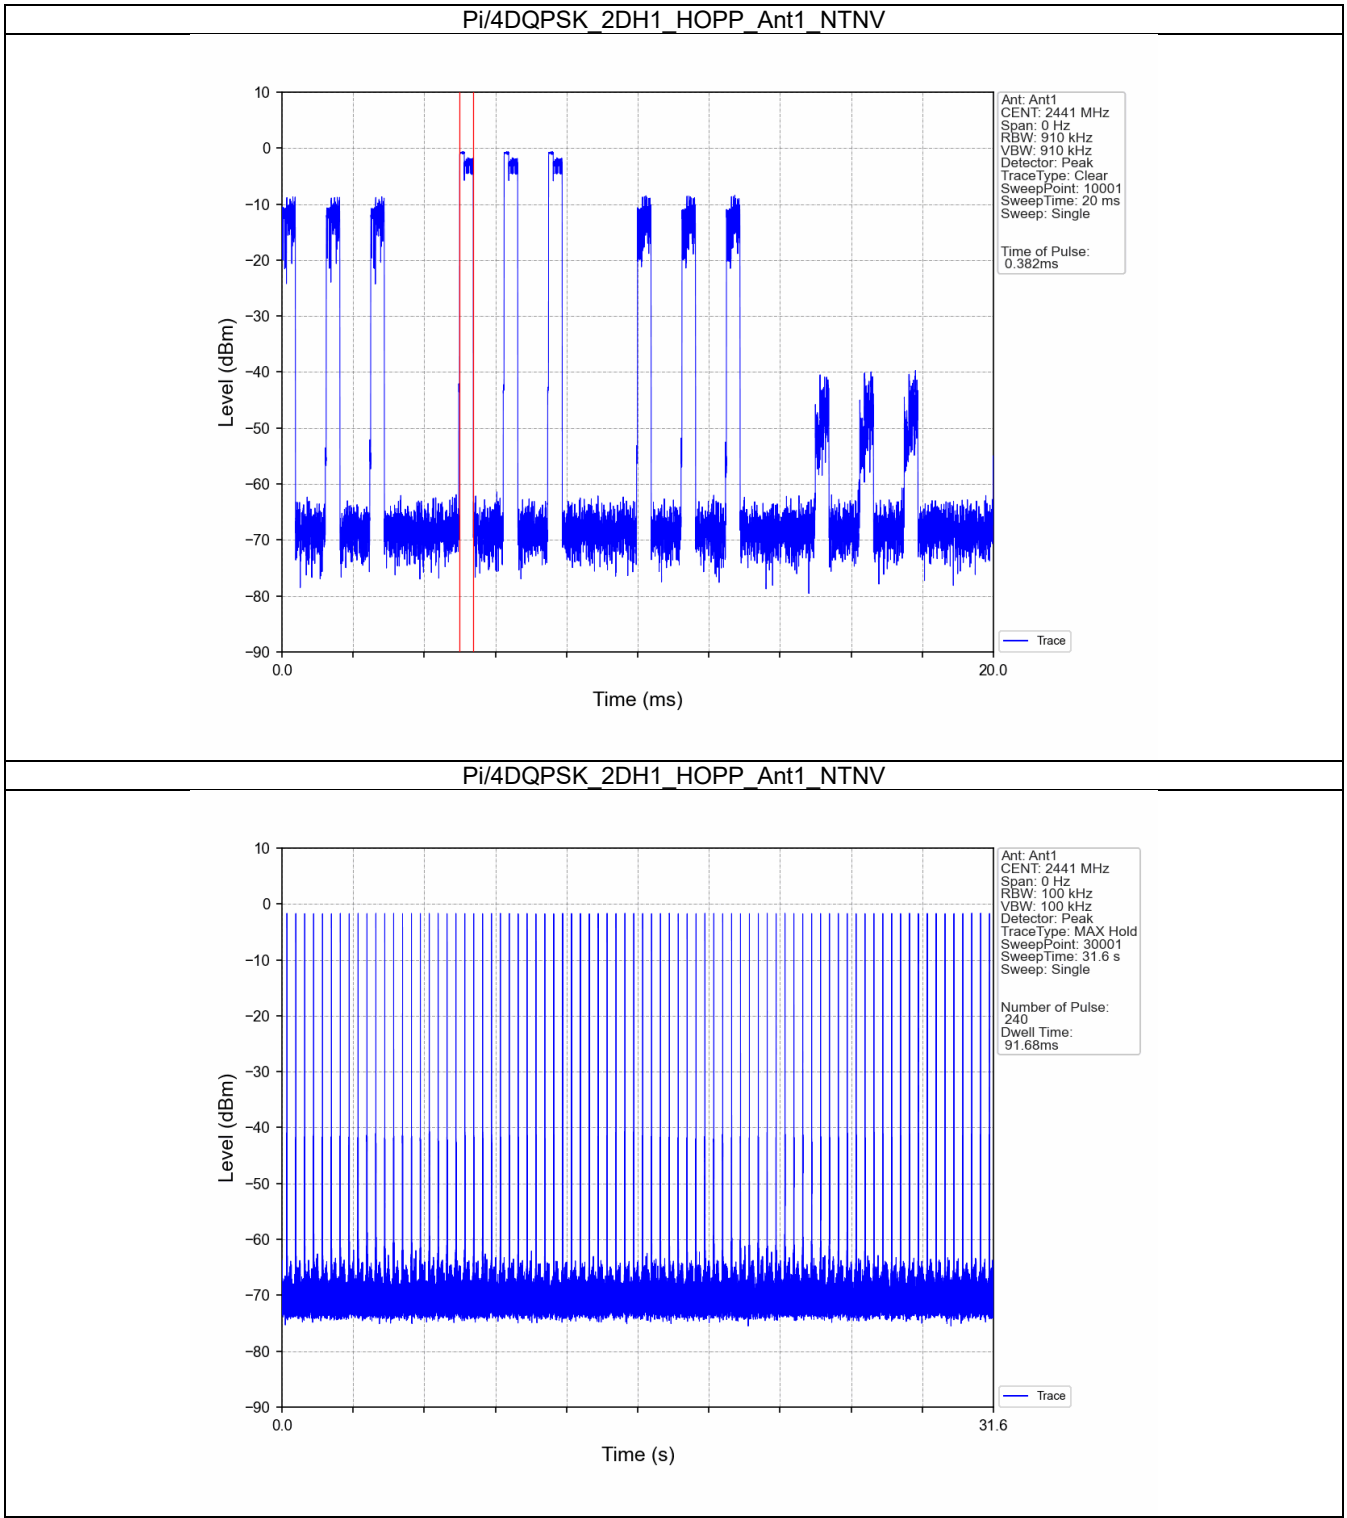


FCC ID: 2BDUR-1202260

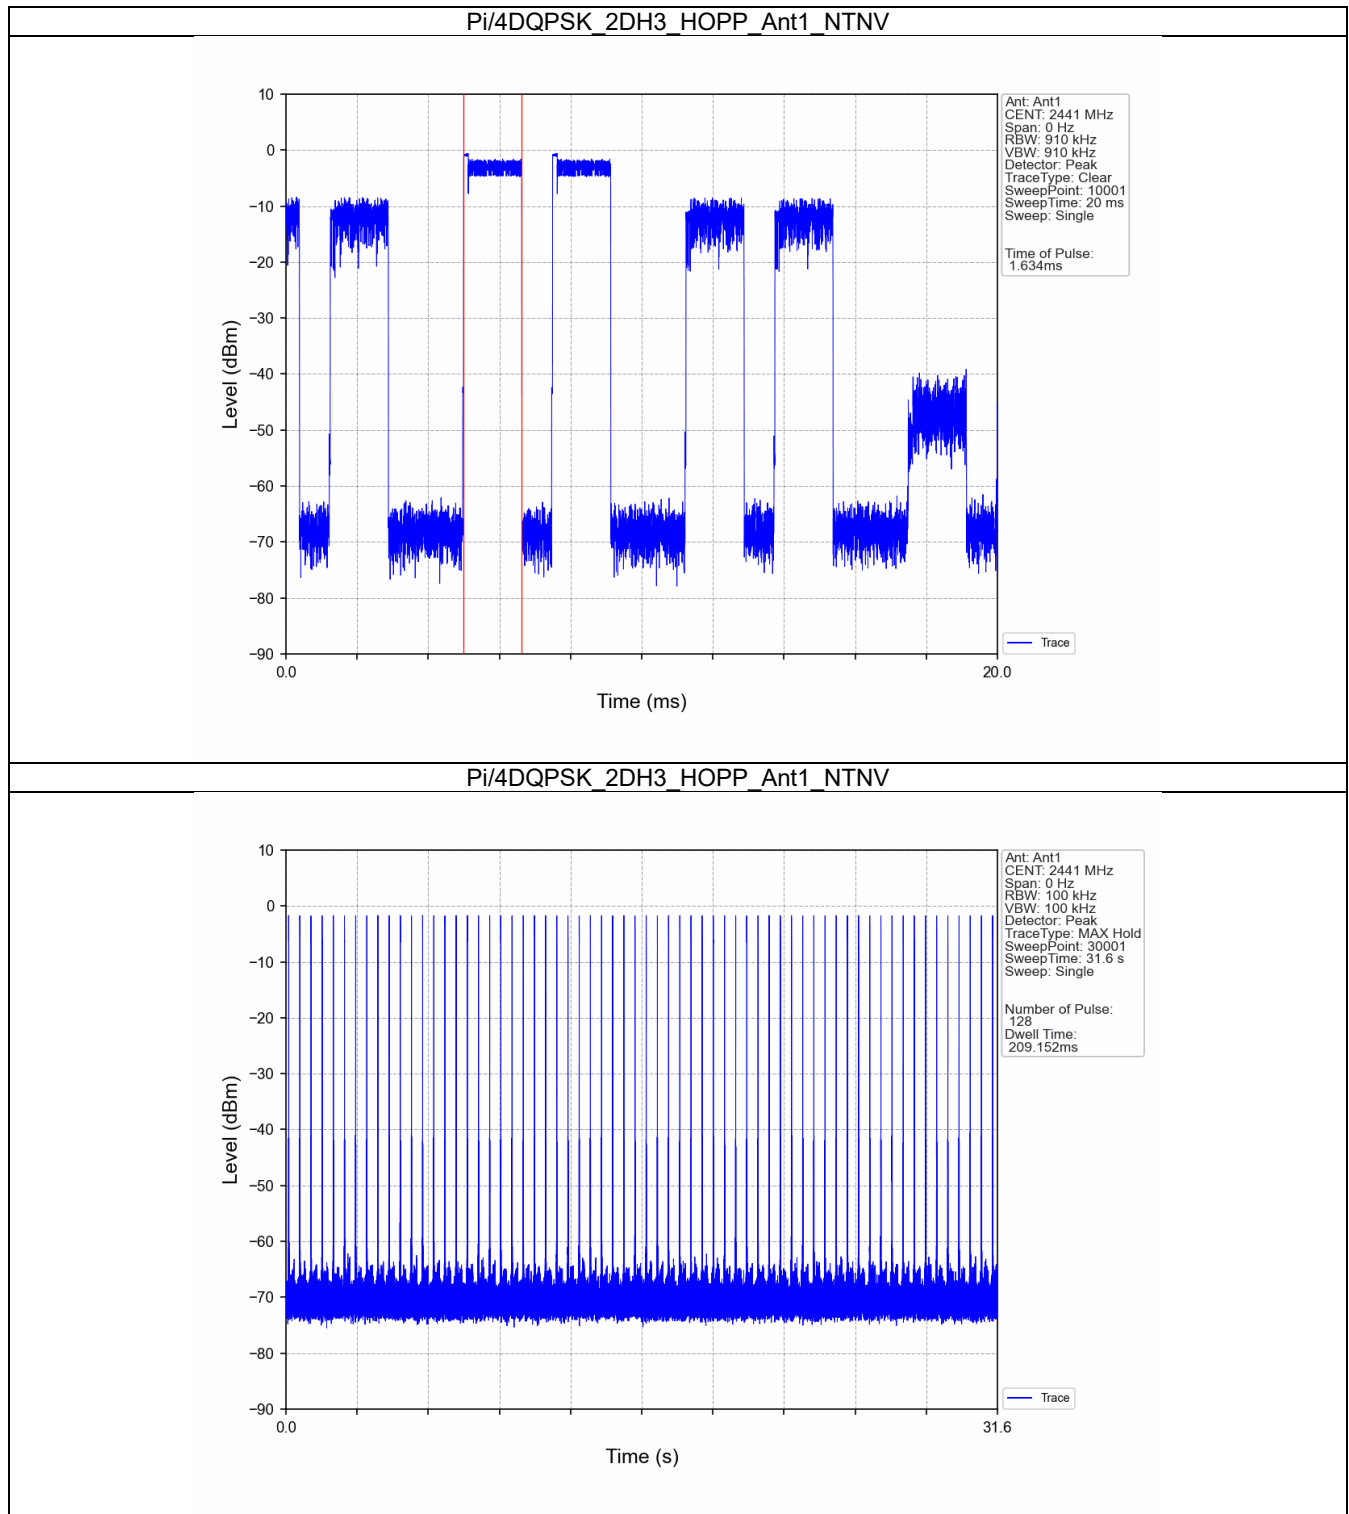


FCC ID: 2BDUR-1202260

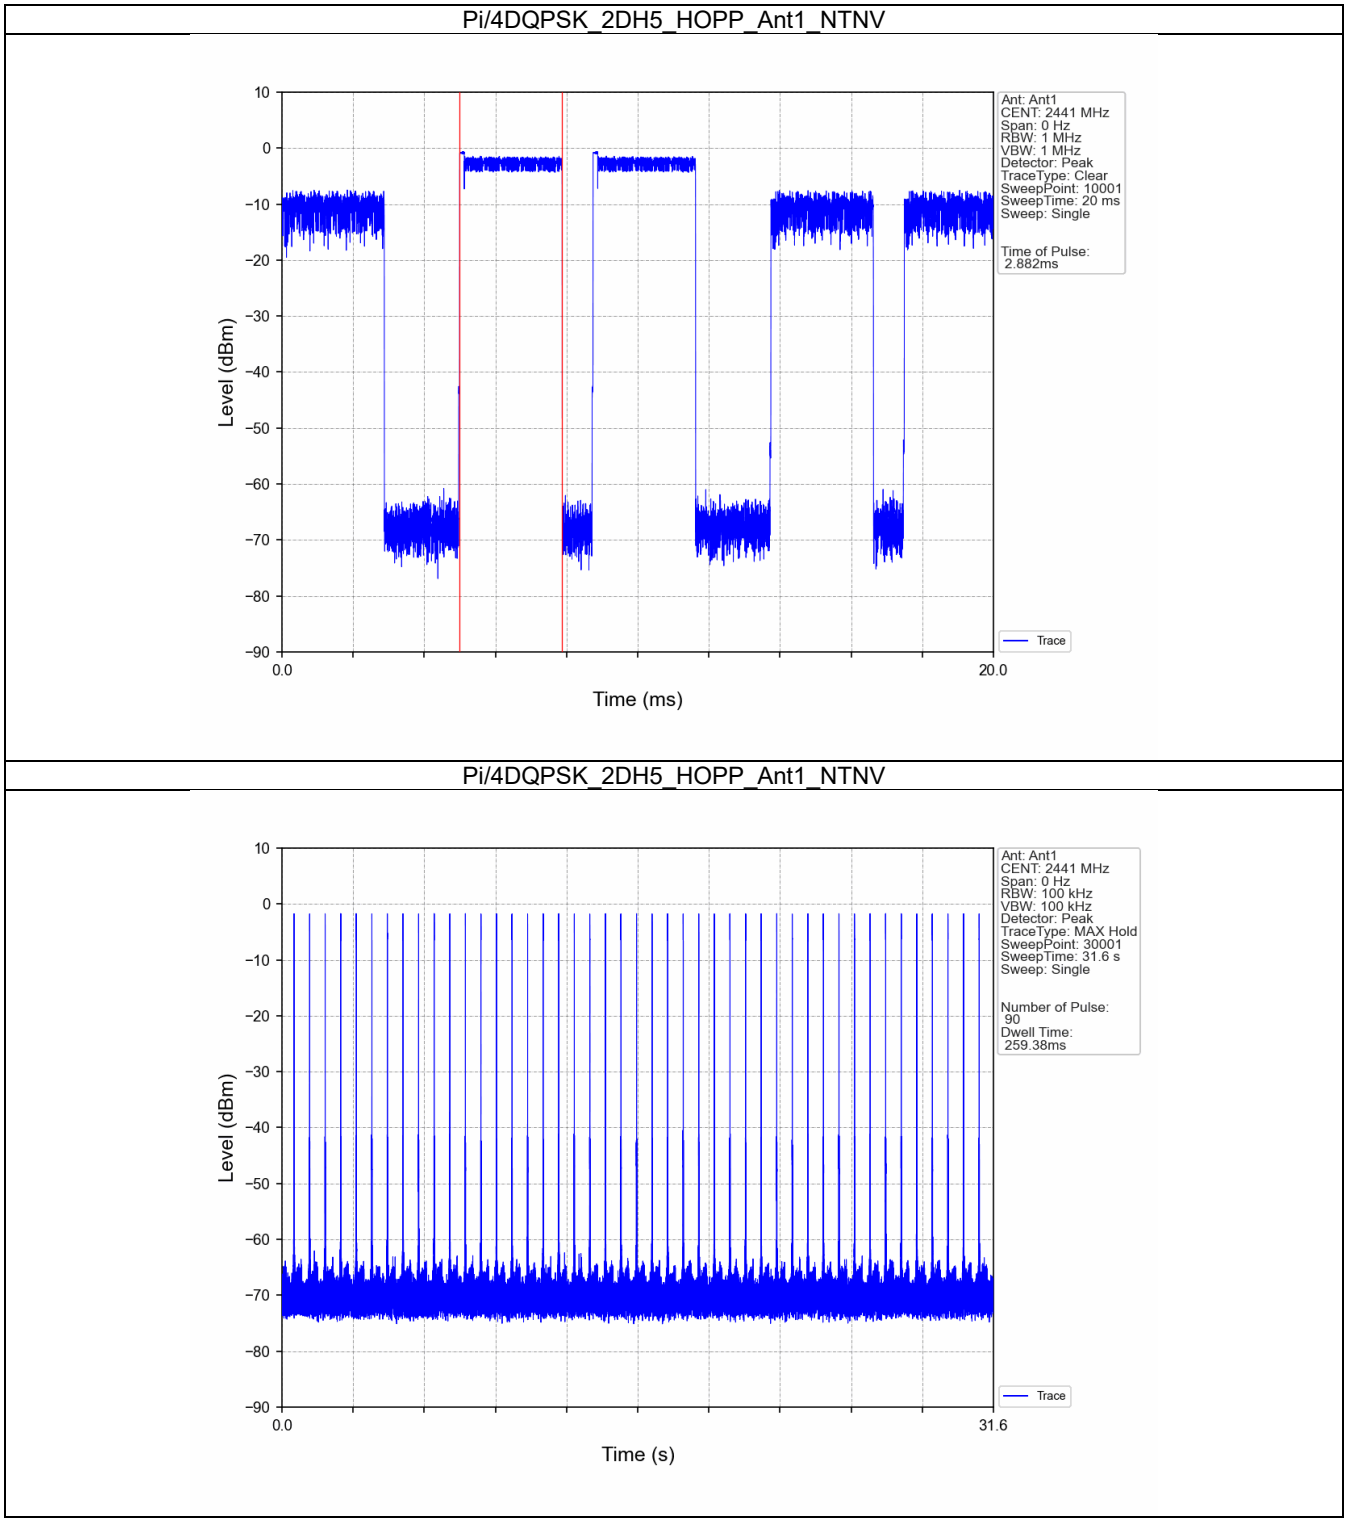


FCC ID: 2BDUR-1202260

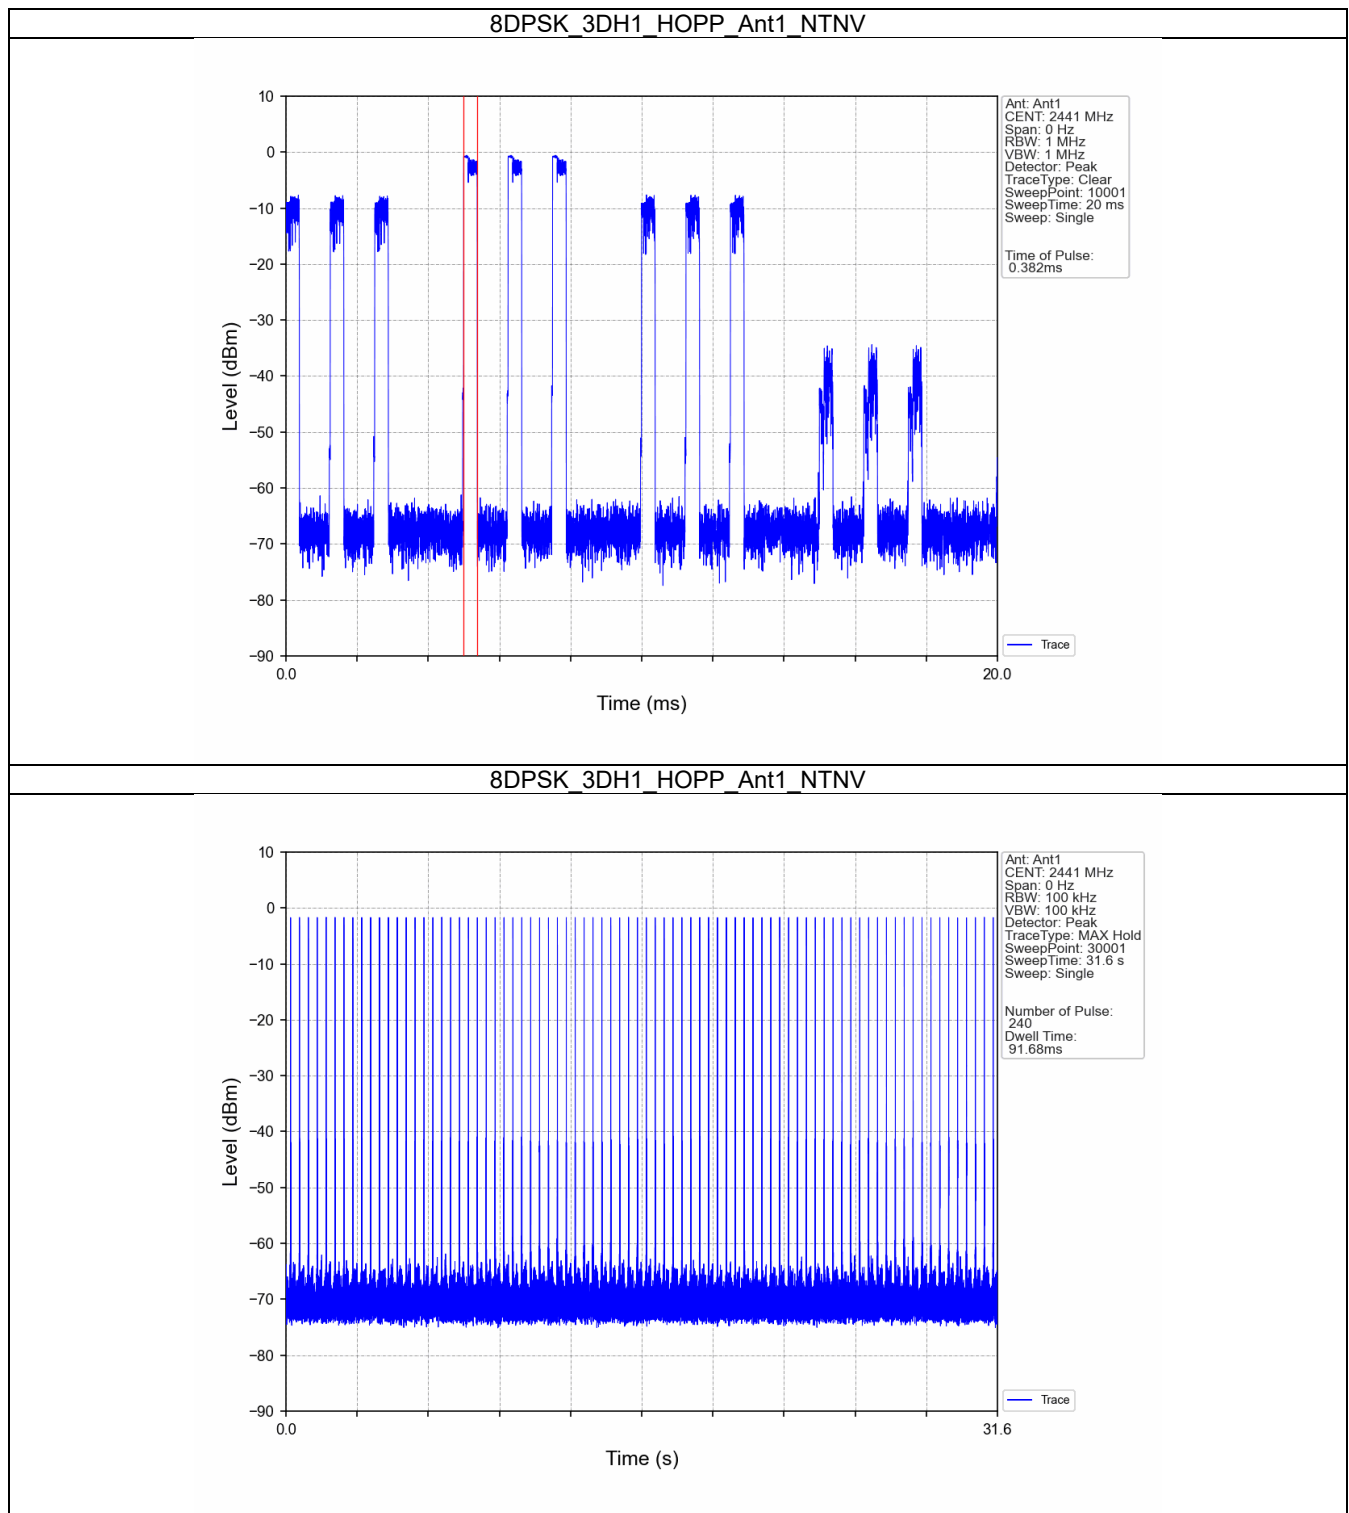

FCC ID: 2BDUR-1202260

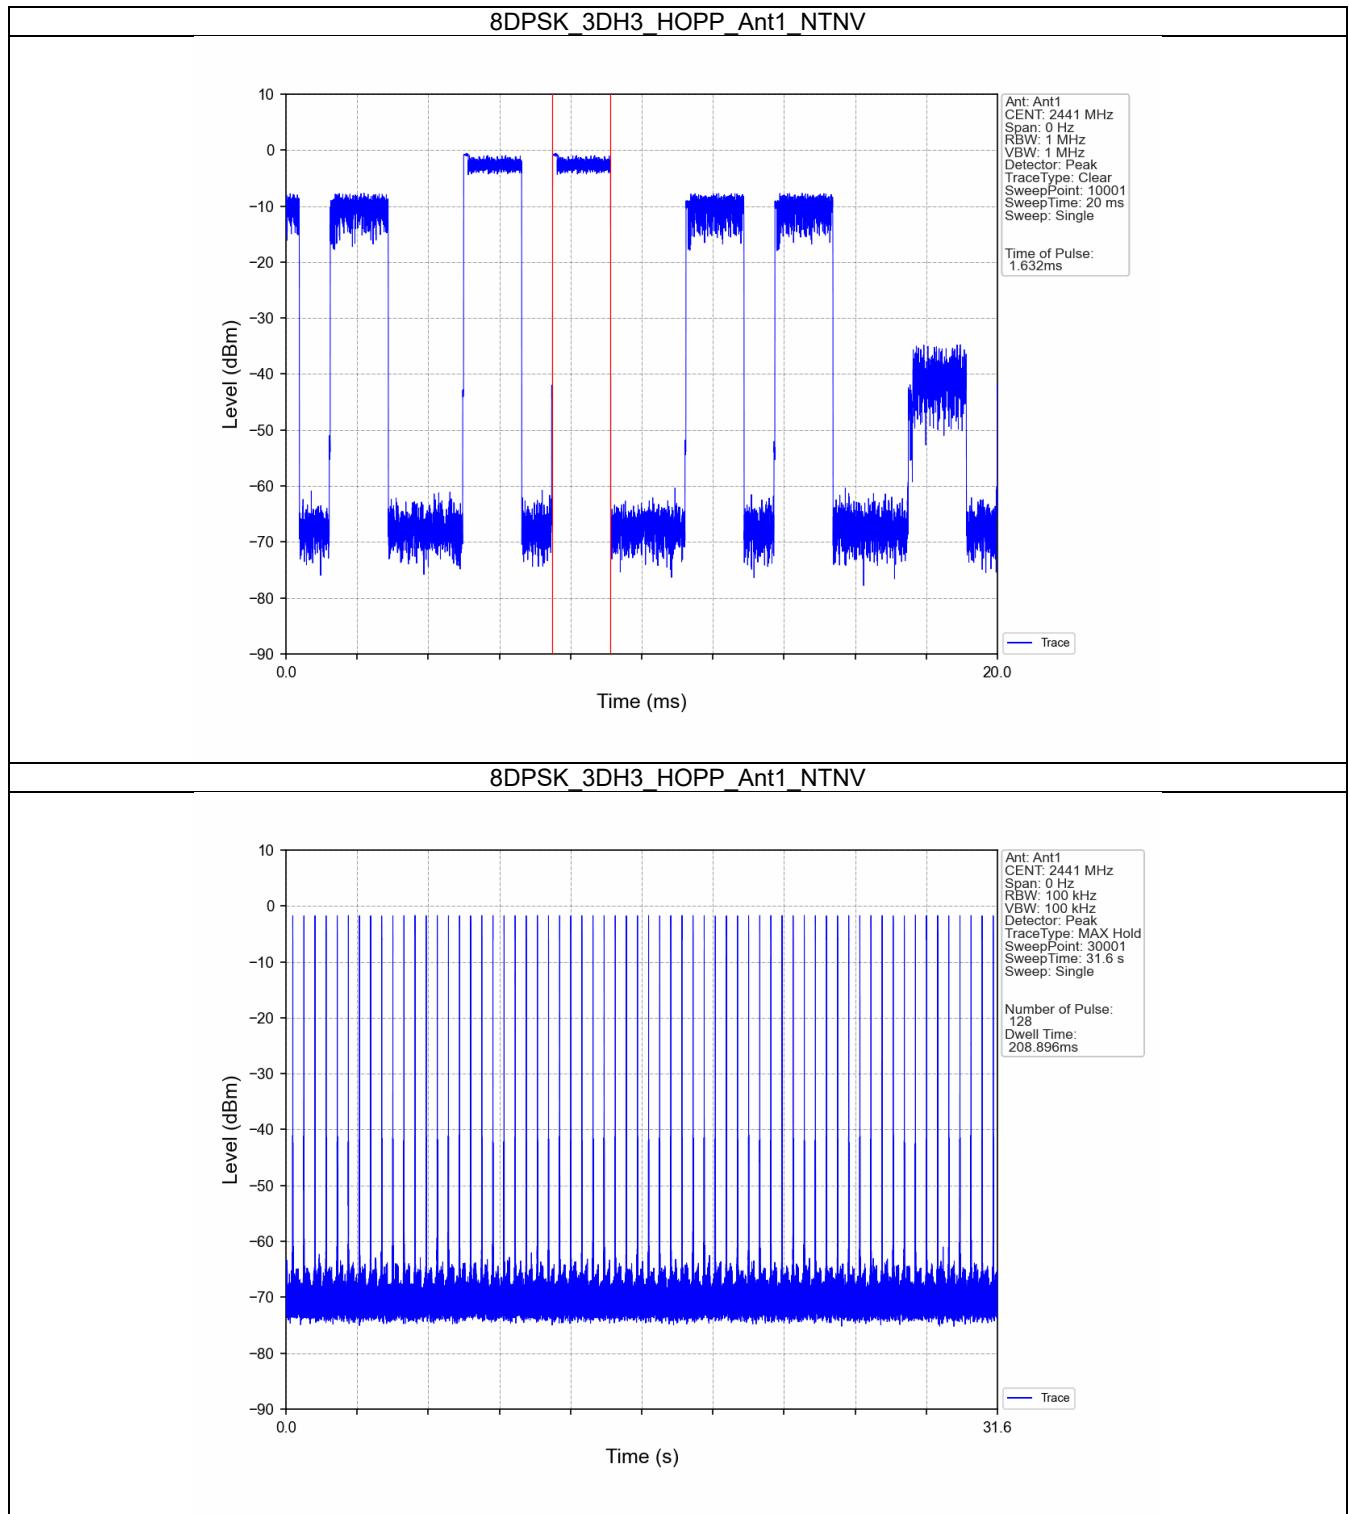

FCC ID: 2BDUR-1202260

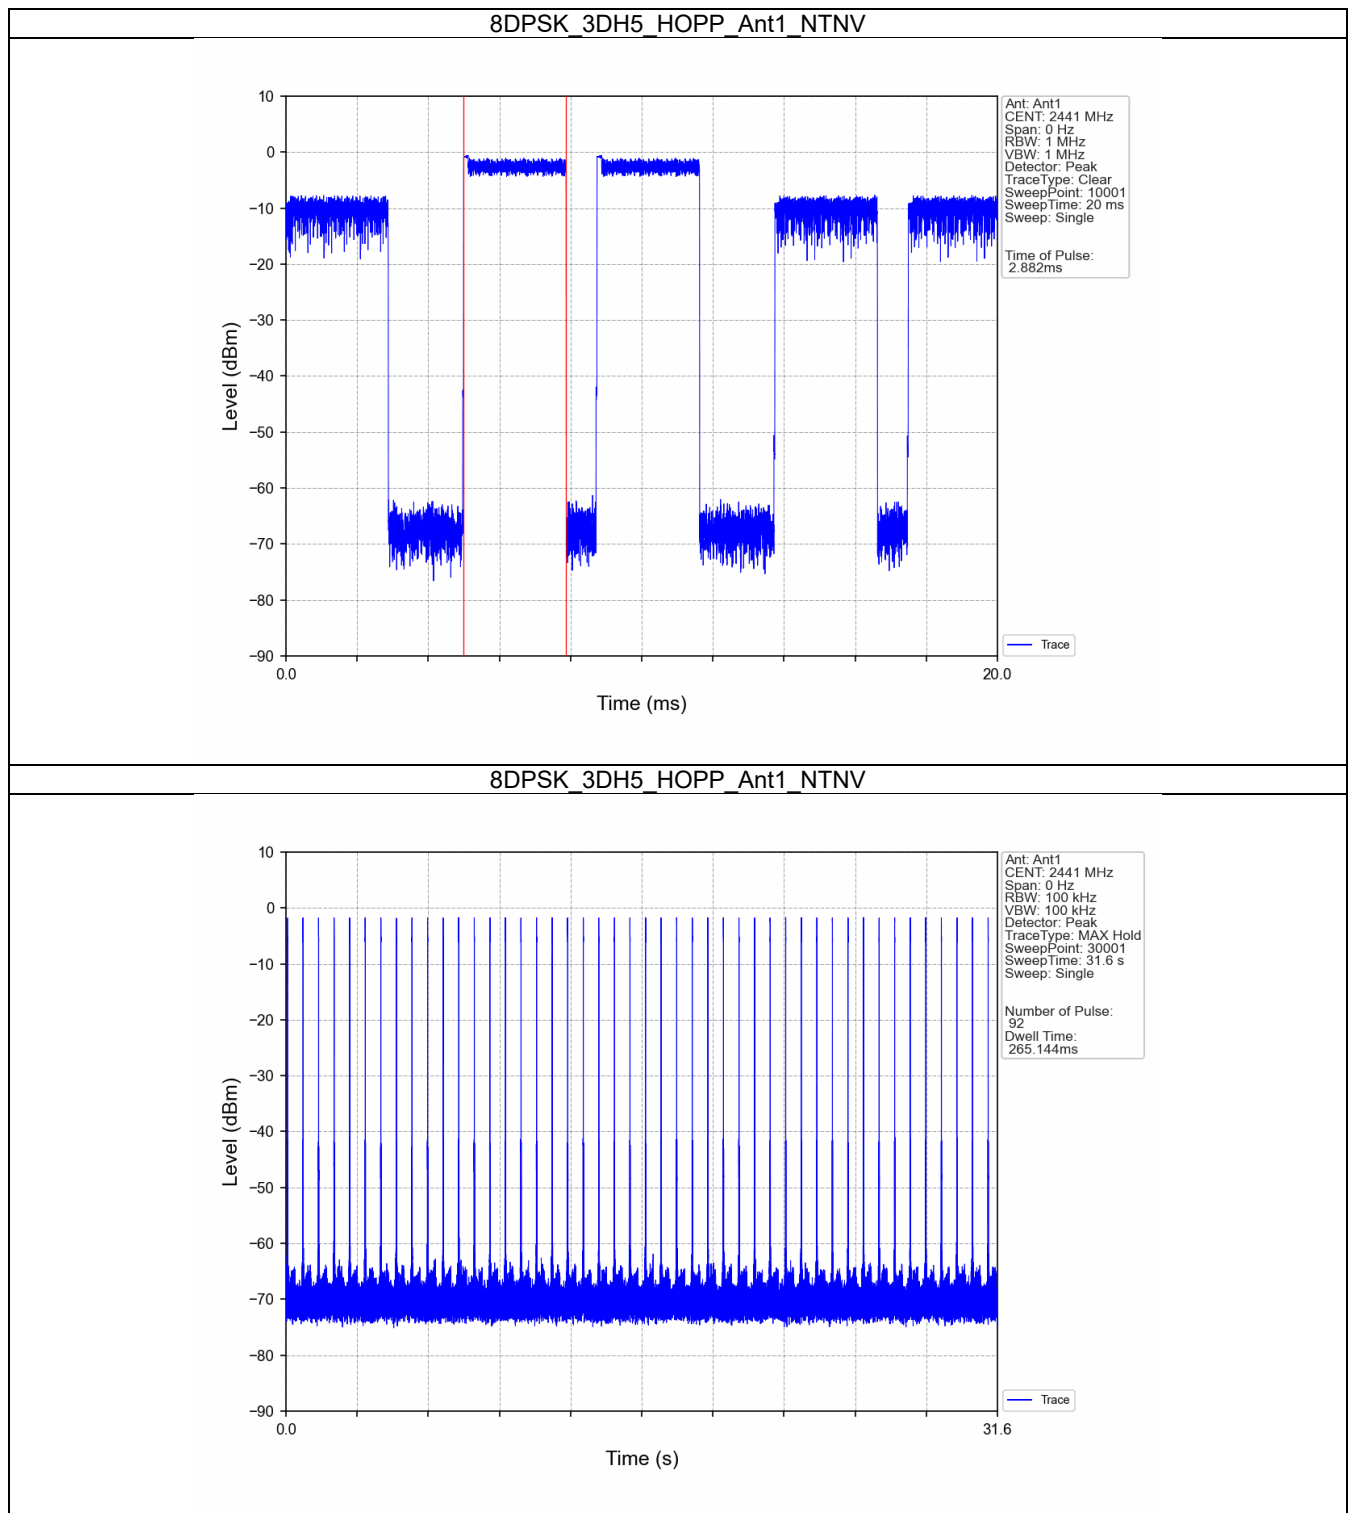

FCC ID: 2BDUR-1202260

6. Unwanted Emissions In Non-restricted Frequency Bands

6.1 Test Result

6.1.1 Ref

Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)
GFSK	SISO	2402	DH5	1	-0.72
		2441	DH5	1	-0.58
		2480	DH5	1	-1.22
Pi/4DQPSK	SISO	2402	2DH5	1	-0.94
		2441	2DH5	1	-0.77
		2480	2DH5	1	-1.41
8DPSK	SISO	2402	3DH5	1	-4.88
		2441	3DH5	1	-0.59
		2480	3DH5	1	-1.21

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.

6.1.2 CSE


Mode	TX Type	Frequency (MHz)	Packet Type	ANT	Level of Reference (dBm)	Limit (dBm)	Verdict
GFSK	SISO	2402	DH5	1	-0.58	-20.58	Pass
		2441	DH5	1	-0.58	-20.58	Pass
		2480	DH5	1	-0.58	-20.58	Pass
		HOPP	DH5	1	-0.58	-20.58	Pass
					-0.58	-20.58	Pass
Pi/4DQPSK	SISO	2402	2DH5	1	-0.77	-20.77	Pass
		2441	2DH5	1	-0.77	-20.77	Pass
		2480	2DH5	1	-0.77	-20.77	Pass
		HOPP	2DH5	1	-0.77	-20.77	Pass
					-0.77	-20.77	Pass
8DPSK	SISO	2402	3DH5	1	-0.59	-20.59	Pass
		2441	3DH5	1	-0.59	-20.59	Pass
		2480	3DH5	1	-0.59	-20.59	Pass
		HOPP	3DH5	1	-0.59	-20.59	Pass
					-0.59	-20.59	Pass

Note1: Refer to FCC Part 15.247 (d) and ANSI C63.10-2013, the channel contains the maximum PSD level was used to establish the reference level.


FCC ID: 2BDUR-1202260

6.2 Test Graph


6.2.1 Ref

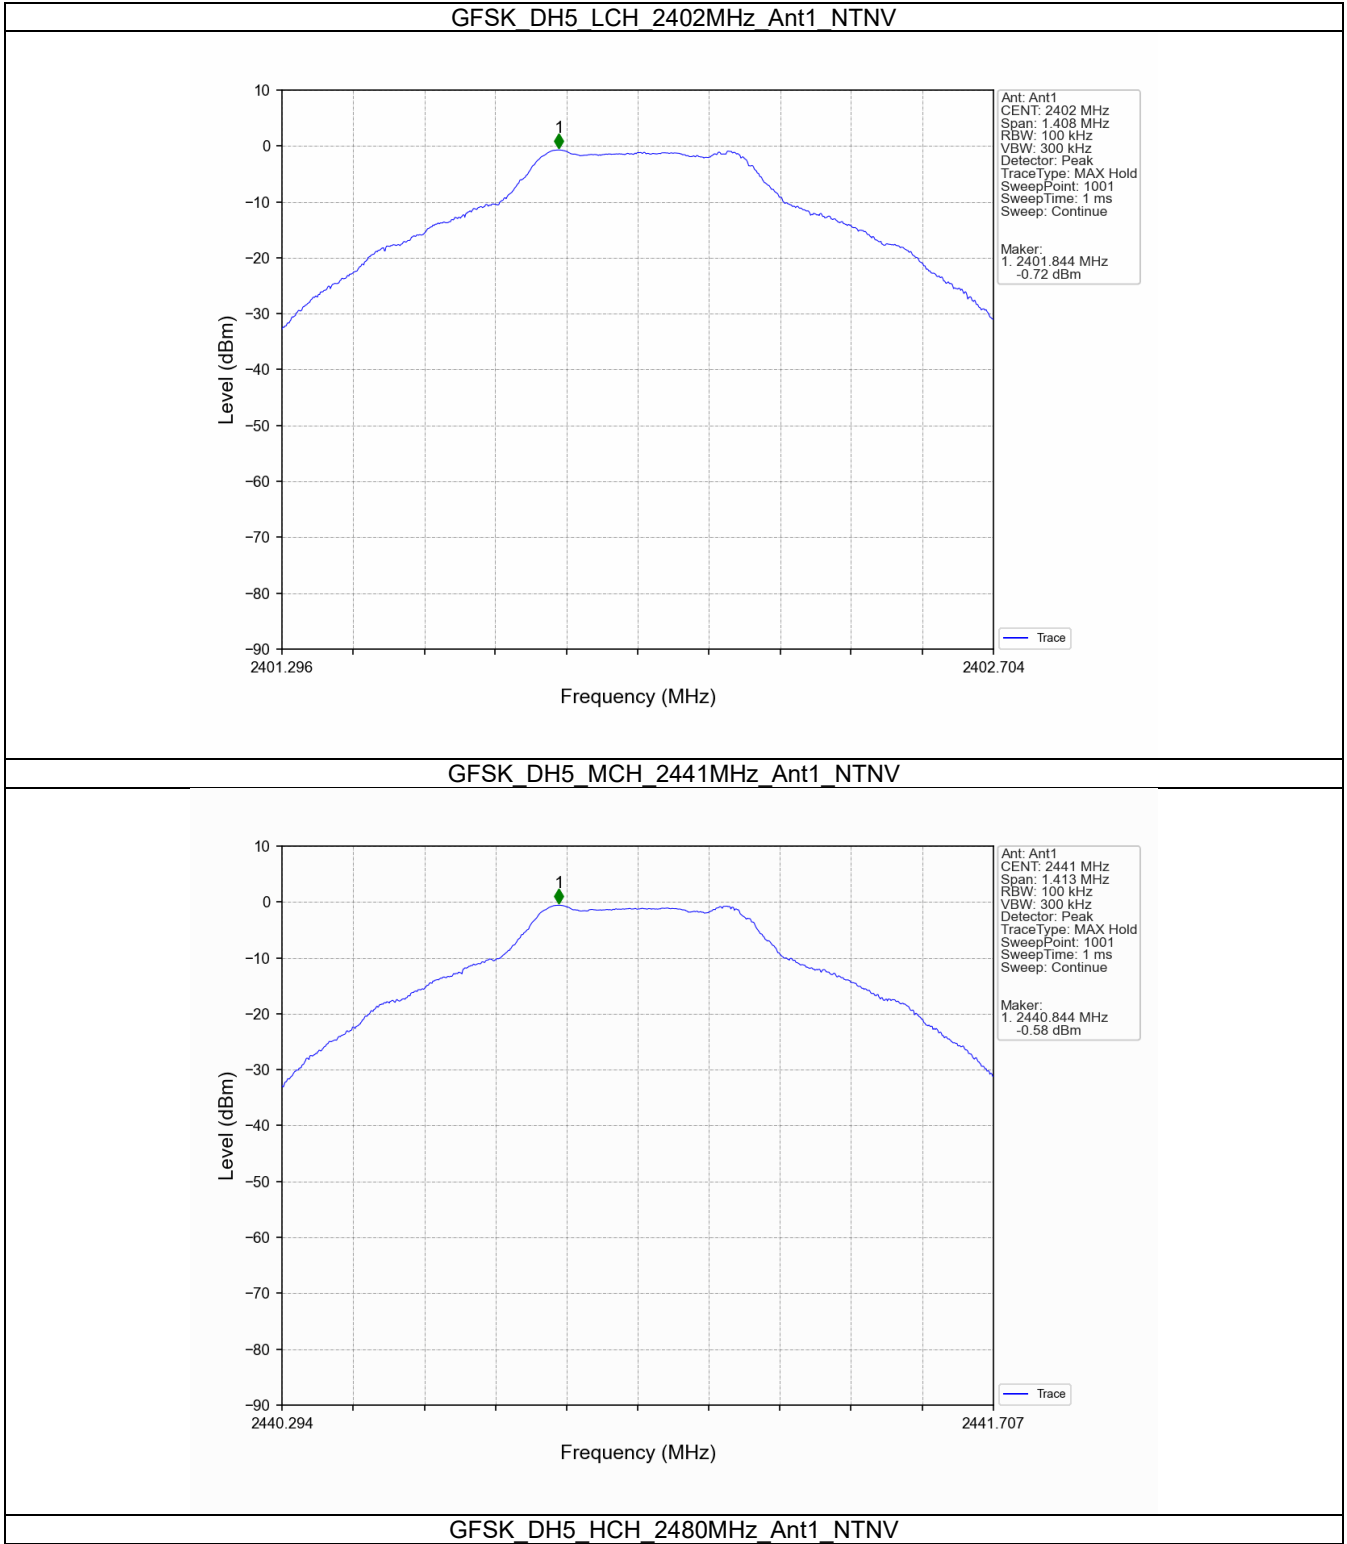


FCC ID: 2BDUR-1202260

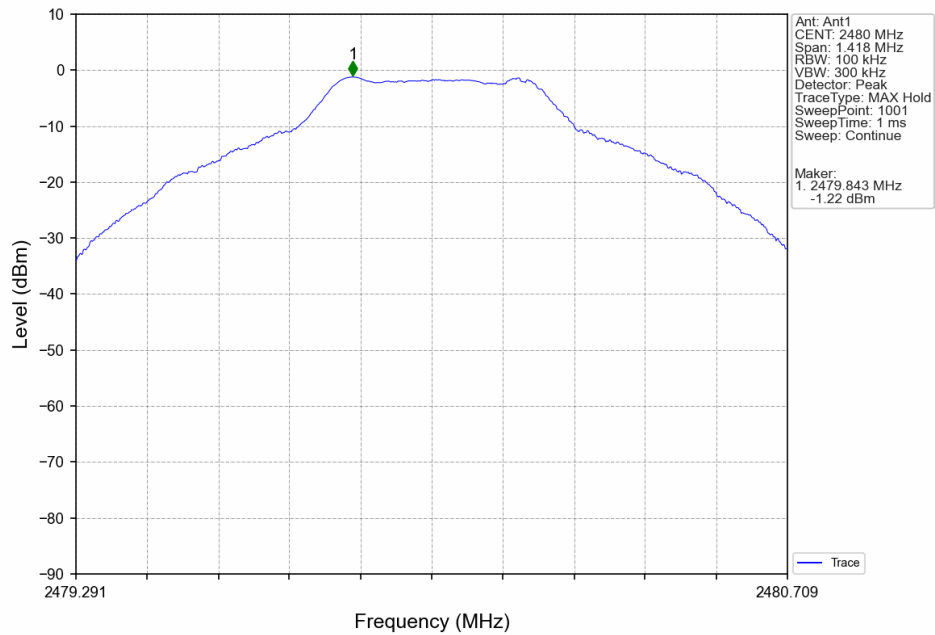


Pi/4DQPSK_2DH5_LCH_2402MHz_Ant1_NTNV

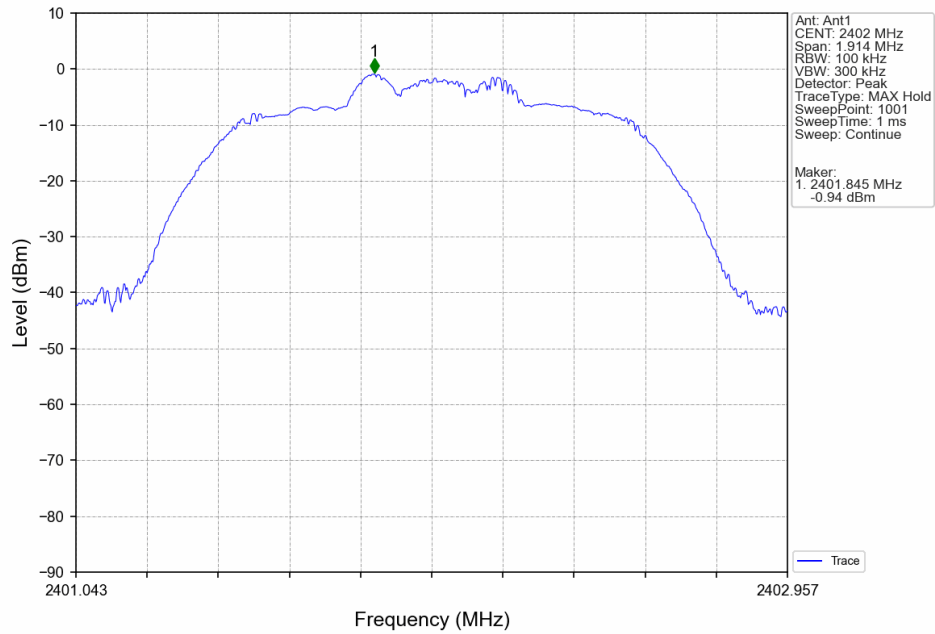


FCC ID: 2BDUR-1202260

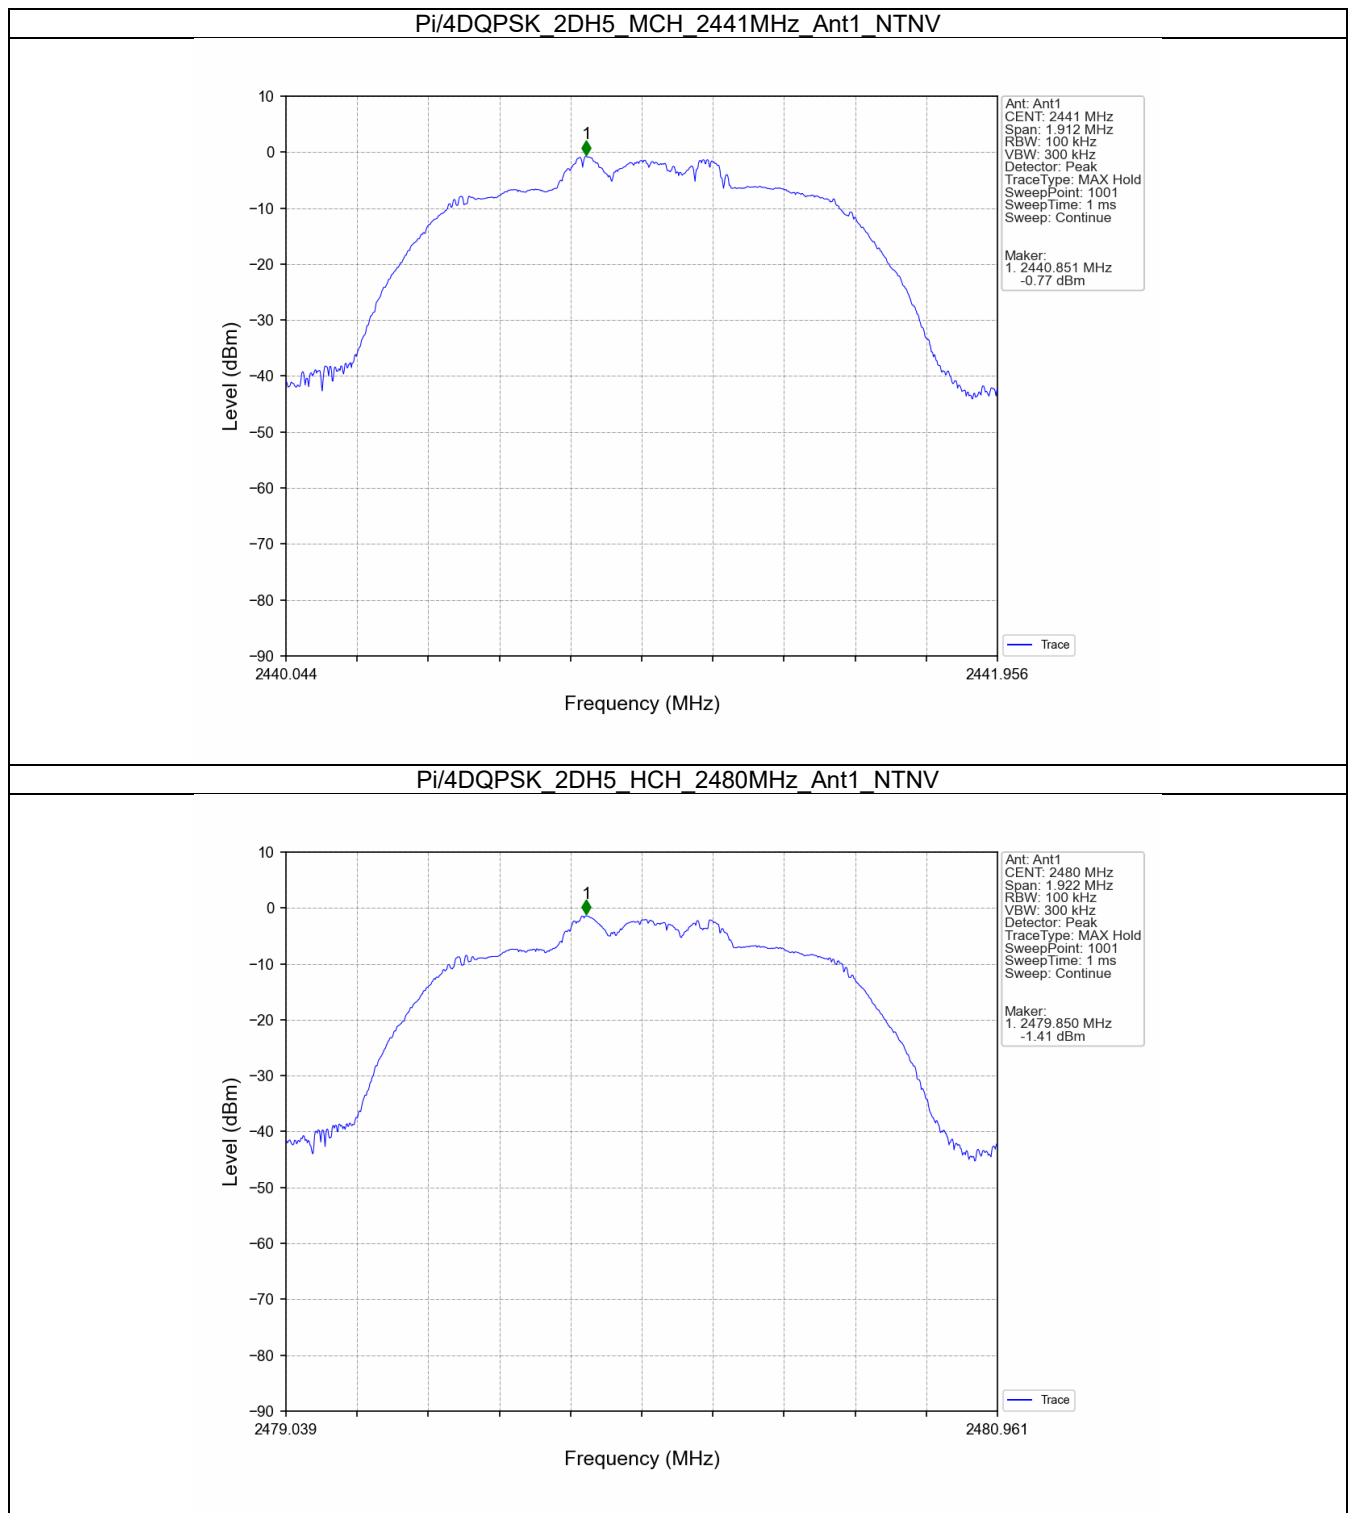

FCC ID: 2BDUR-1202260

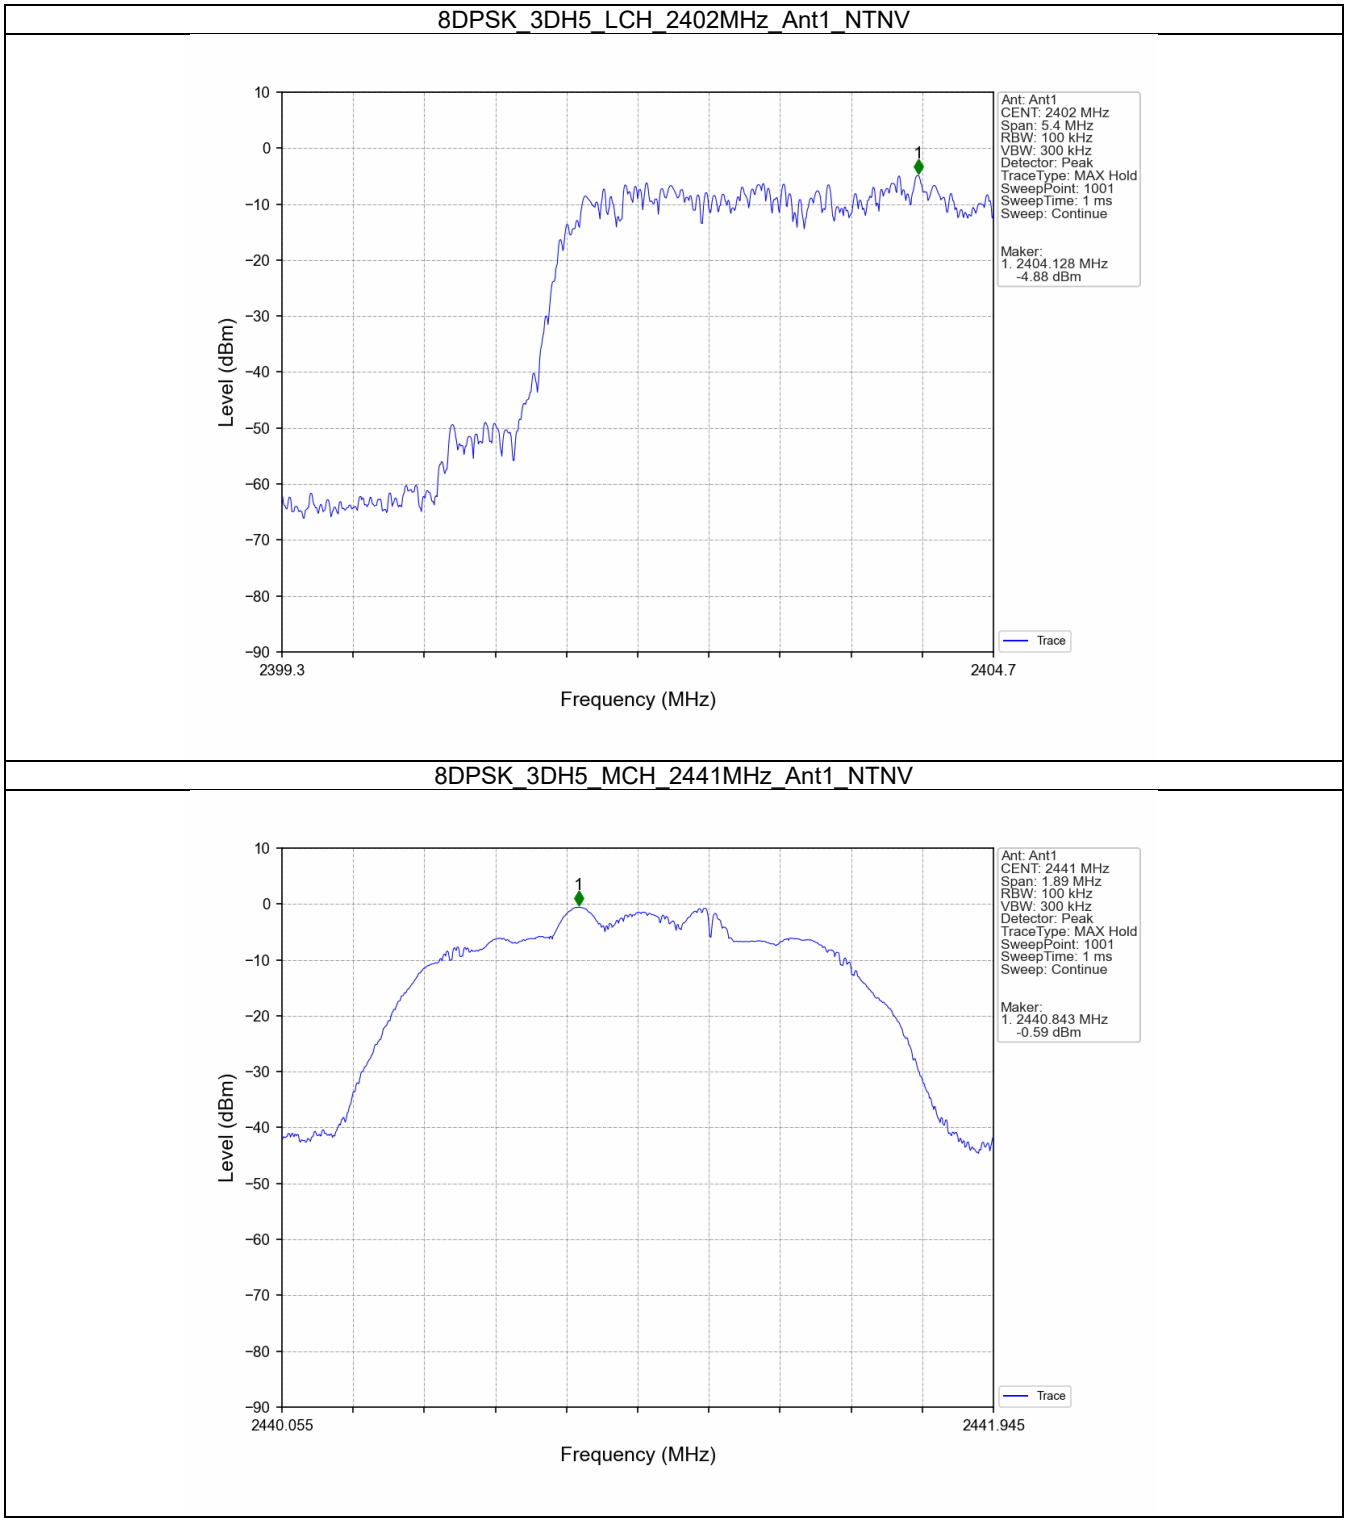


FCC ID: 2BDUR-1202260

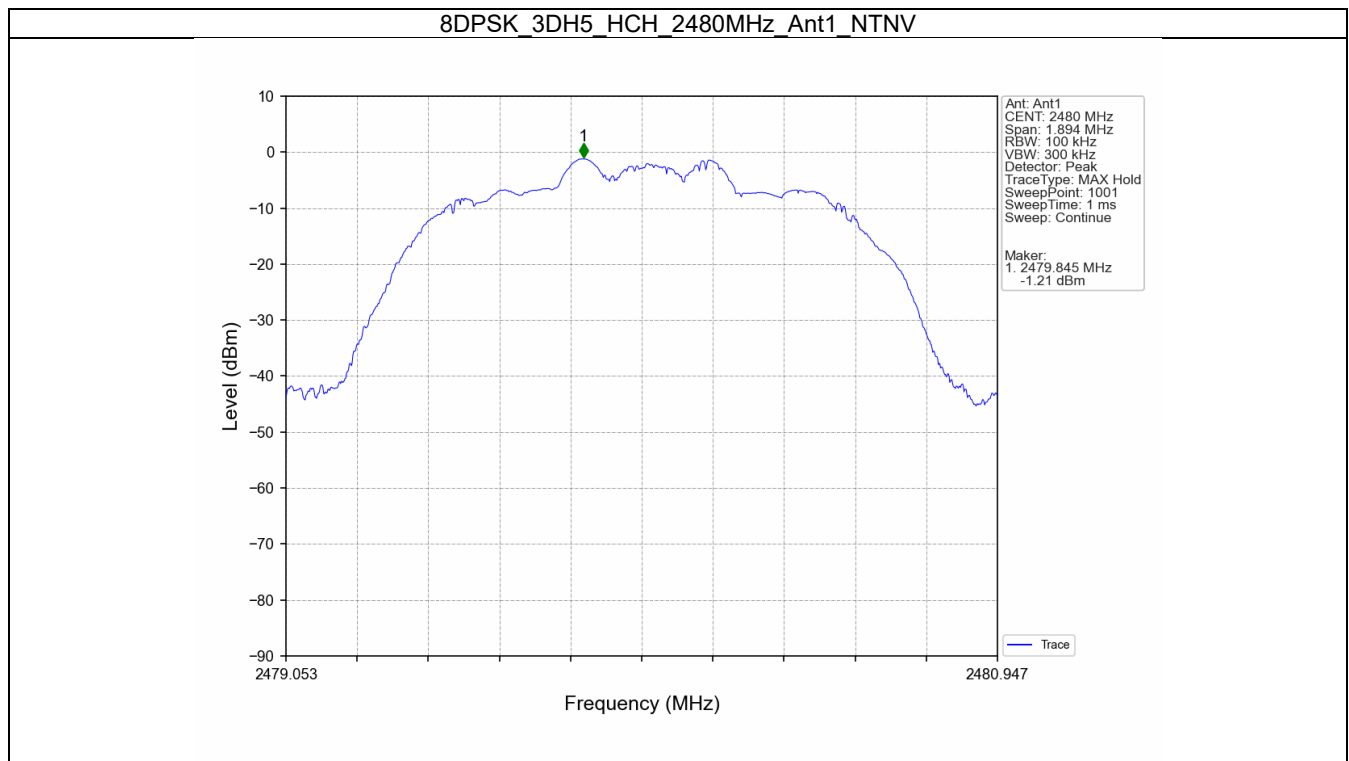


FCC ID: 2BDUR-1202260


6.2.2 CSE

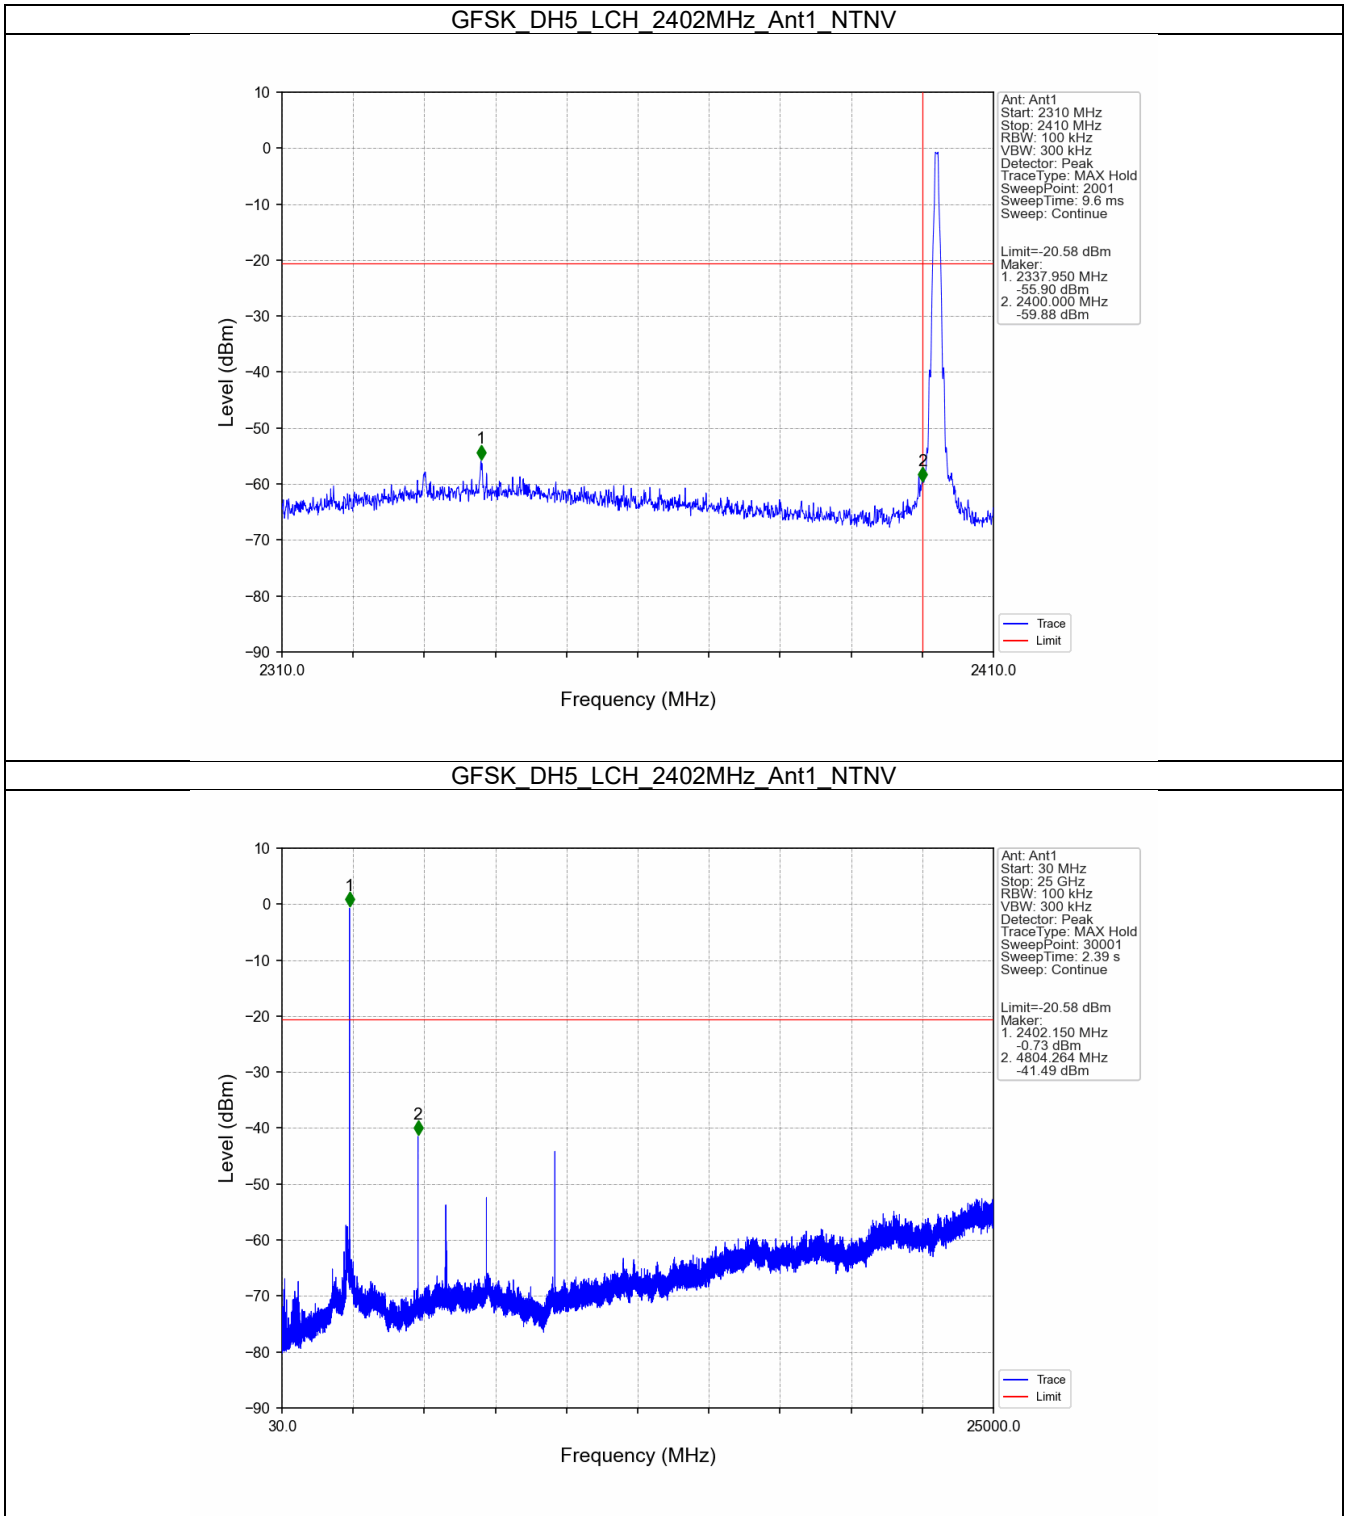


FCC ID: 2BDUR-1202260

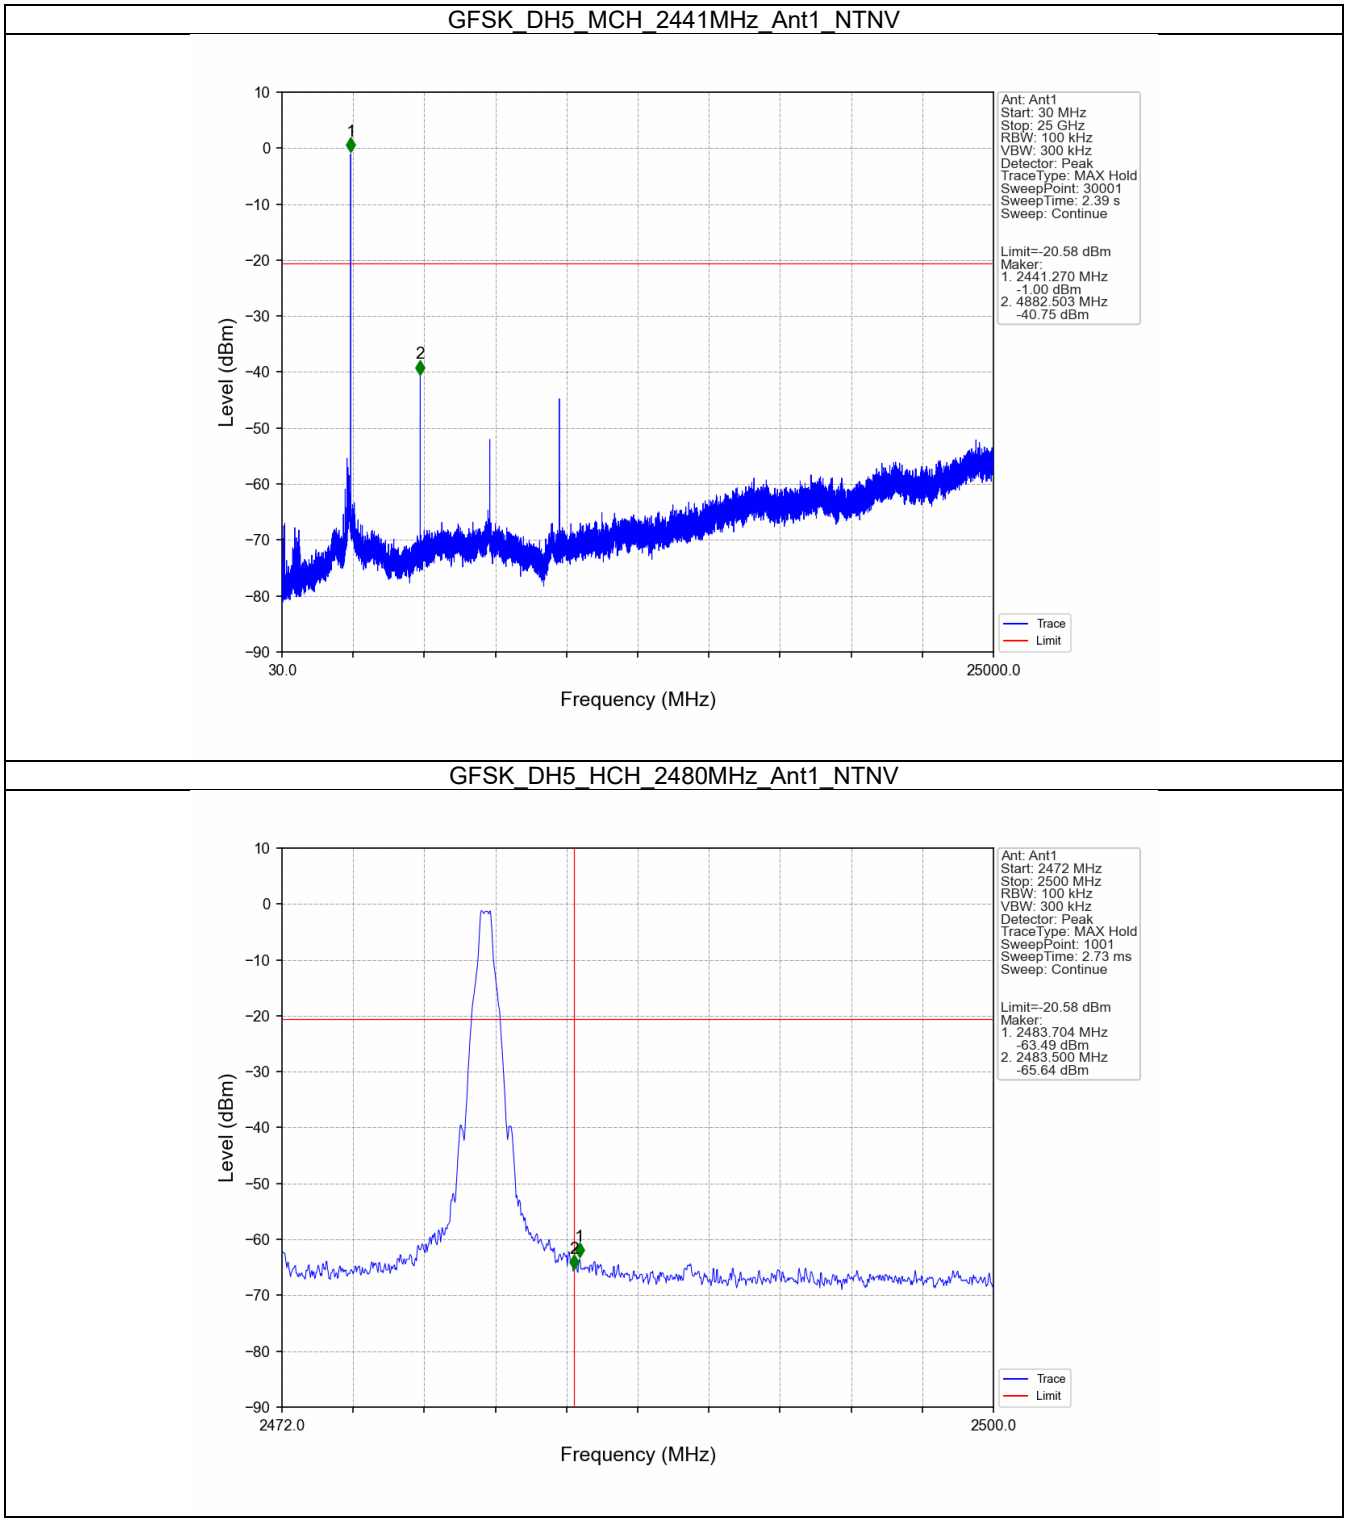


FCC ID: 2BDUR-1202260

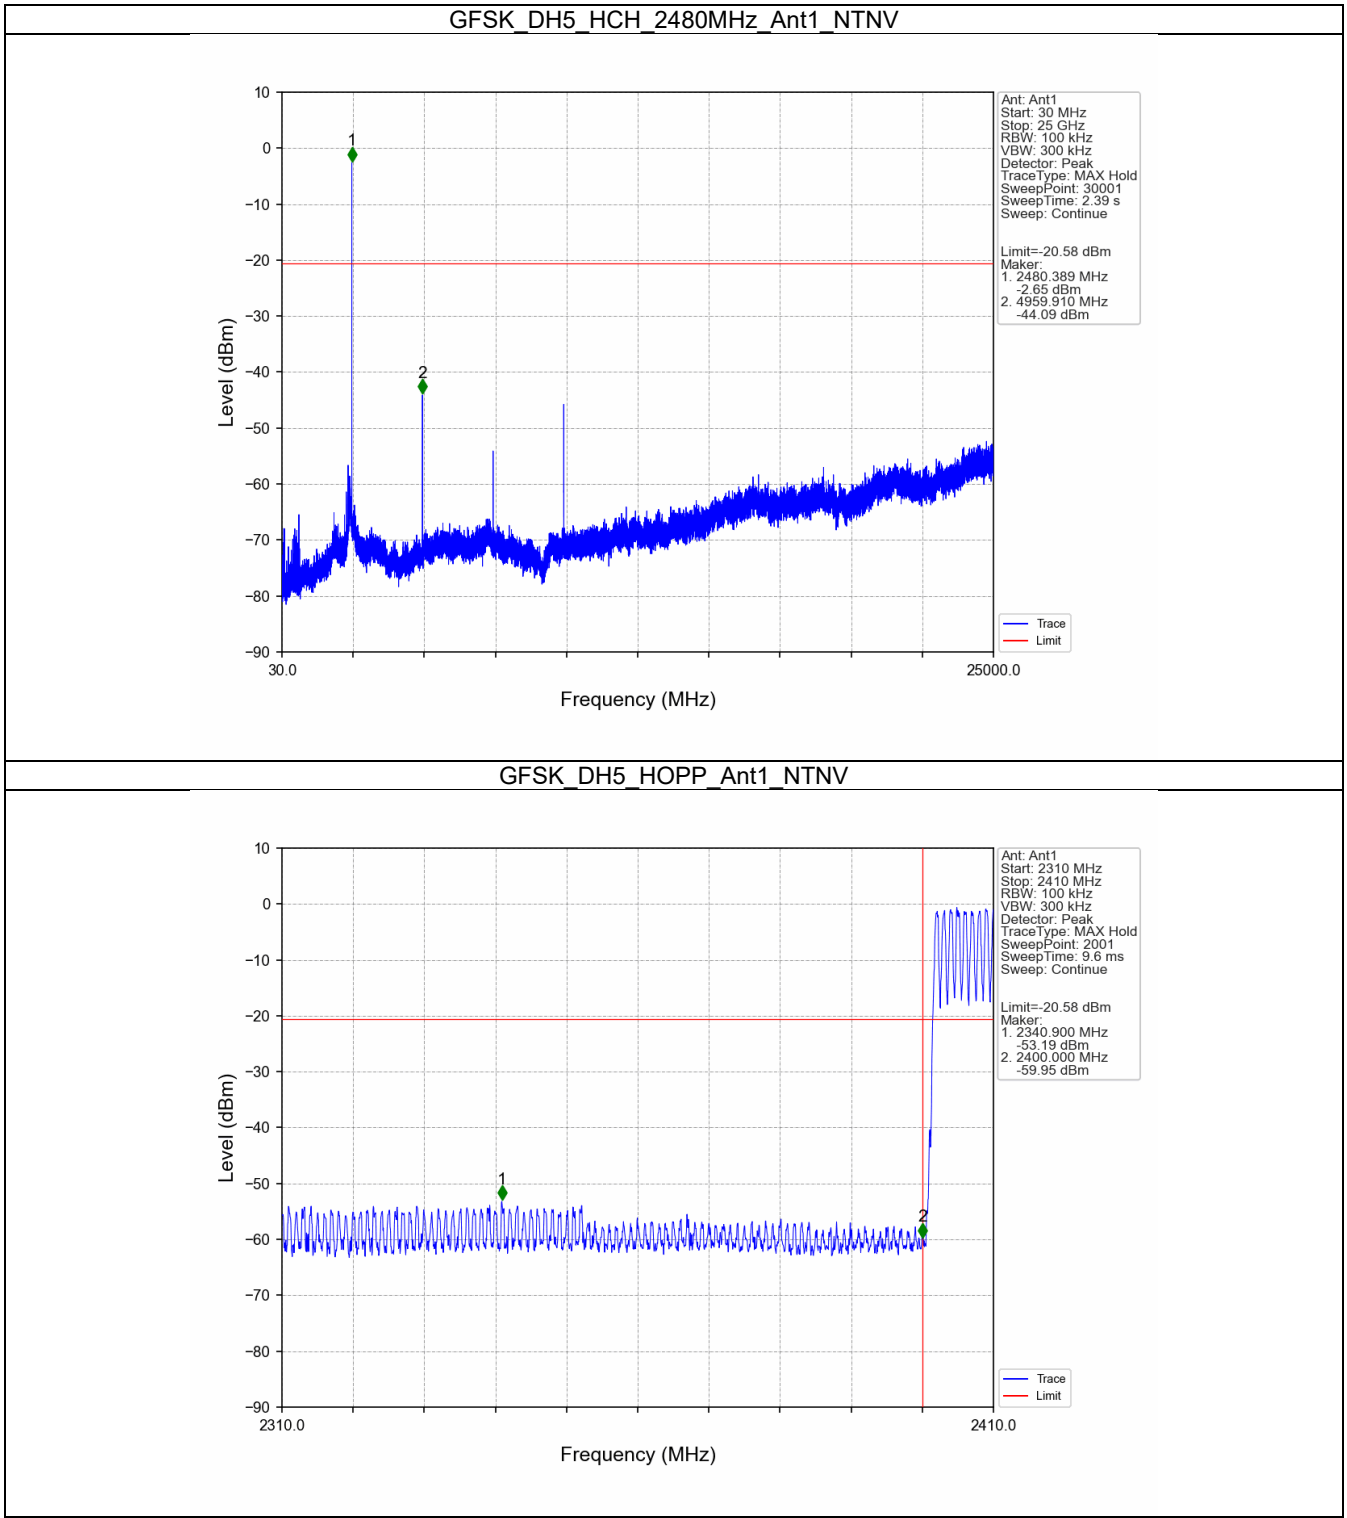


FCC ID: 2BDUR-1202260

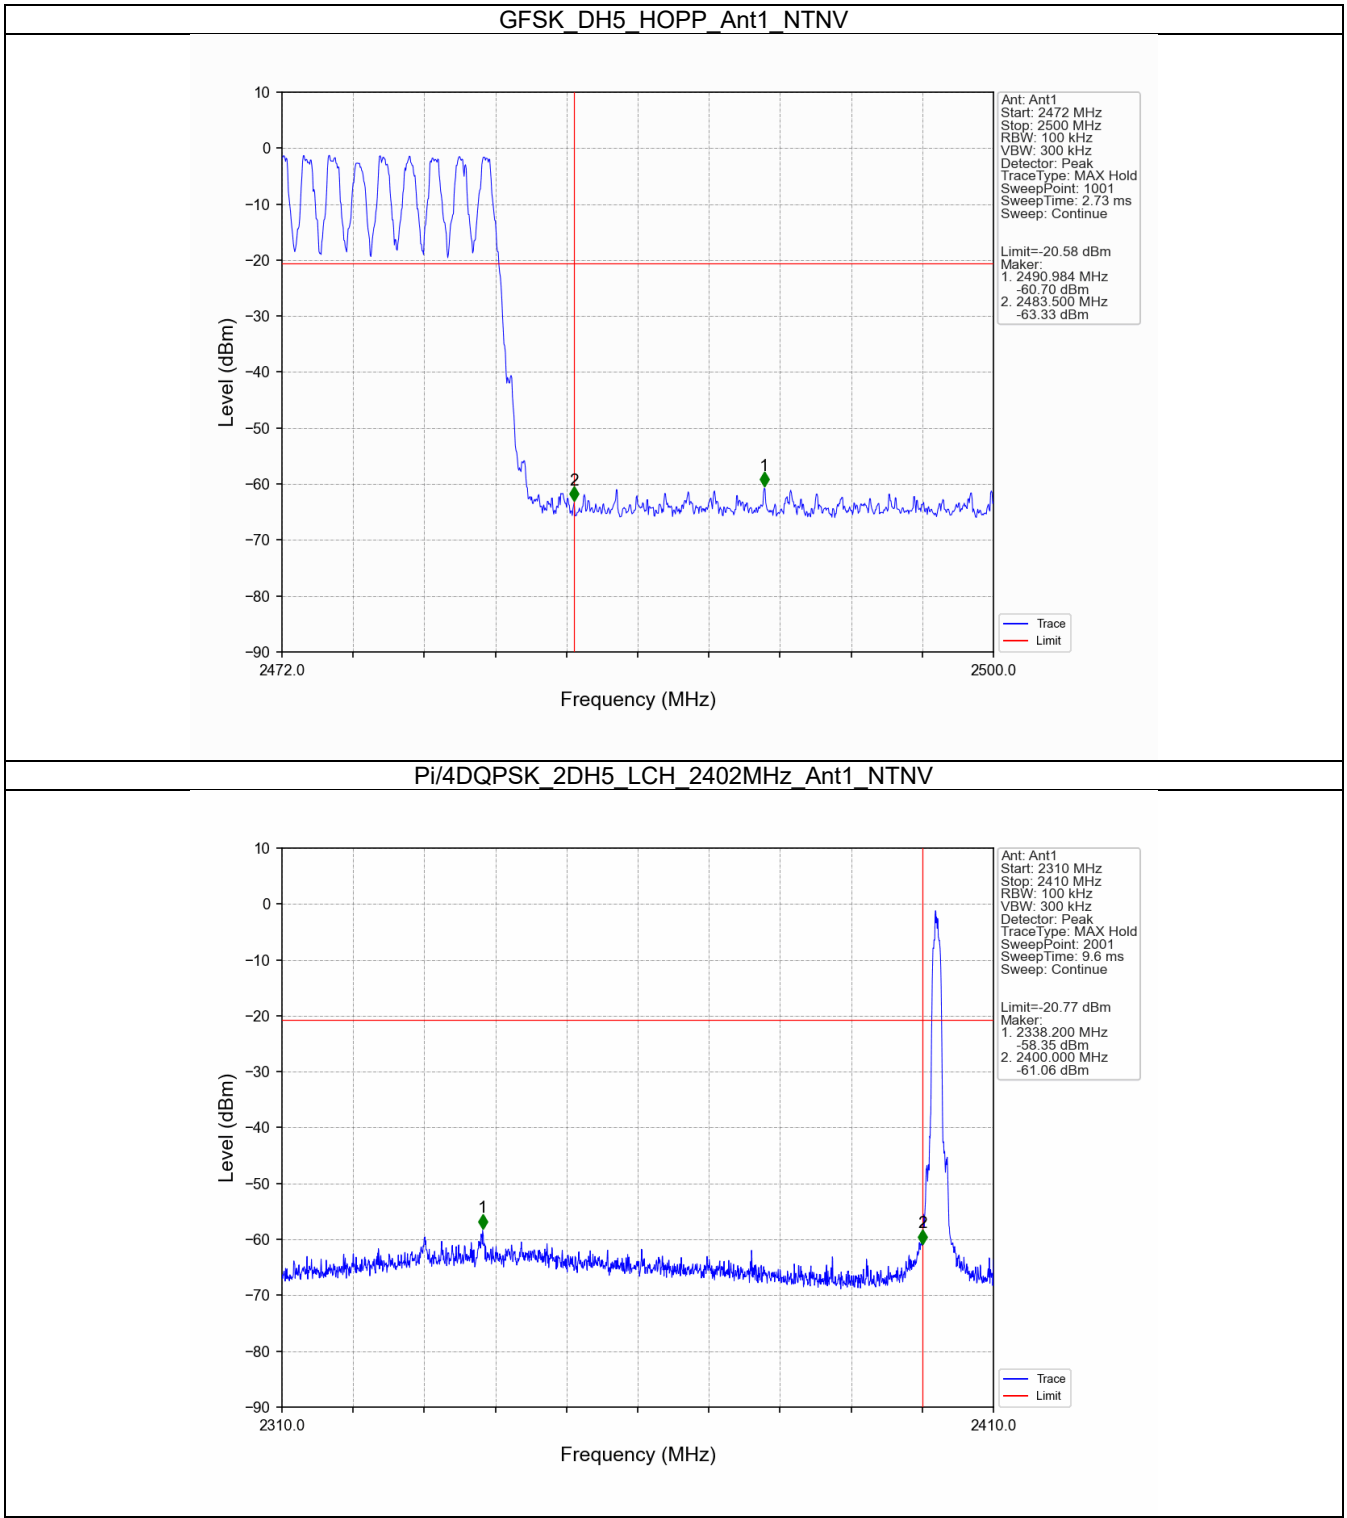


FCC ID: 2BDUR-1202260

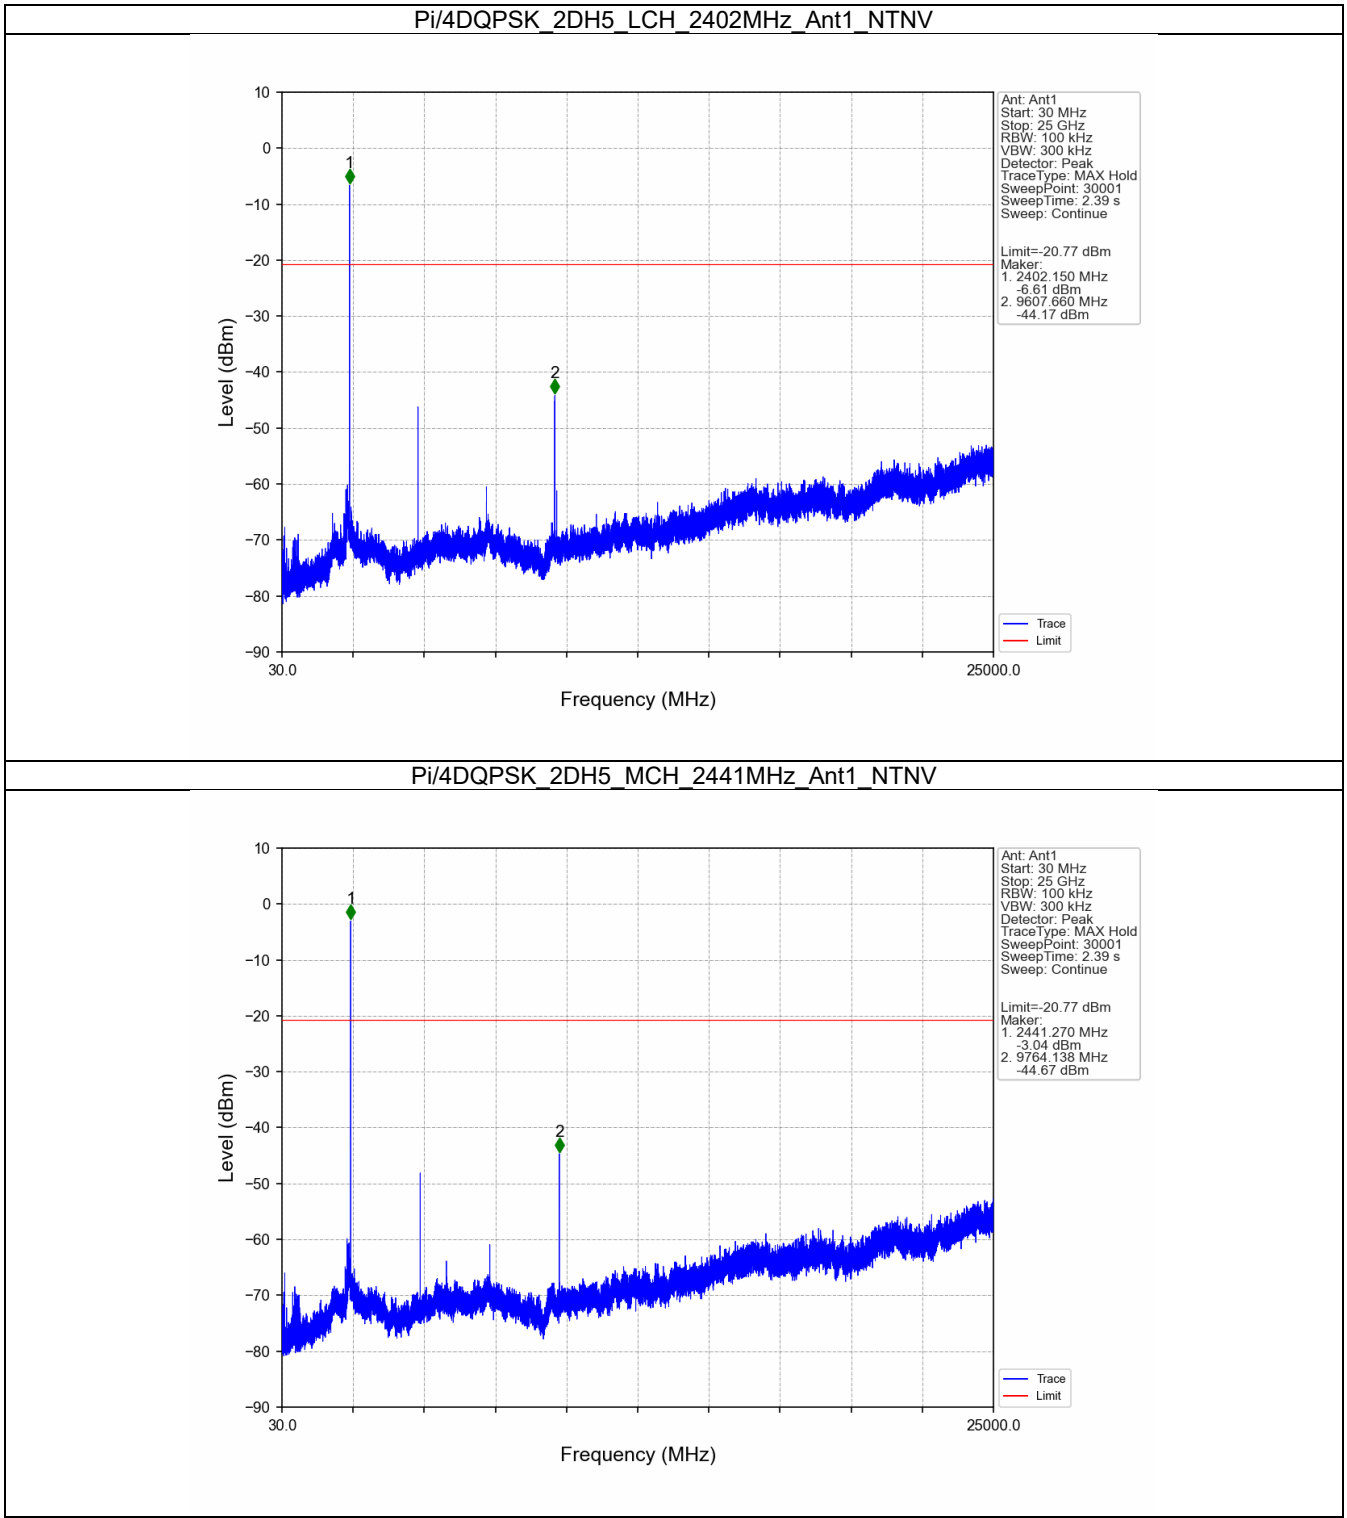


FCC ID: 2BDUR-1202260

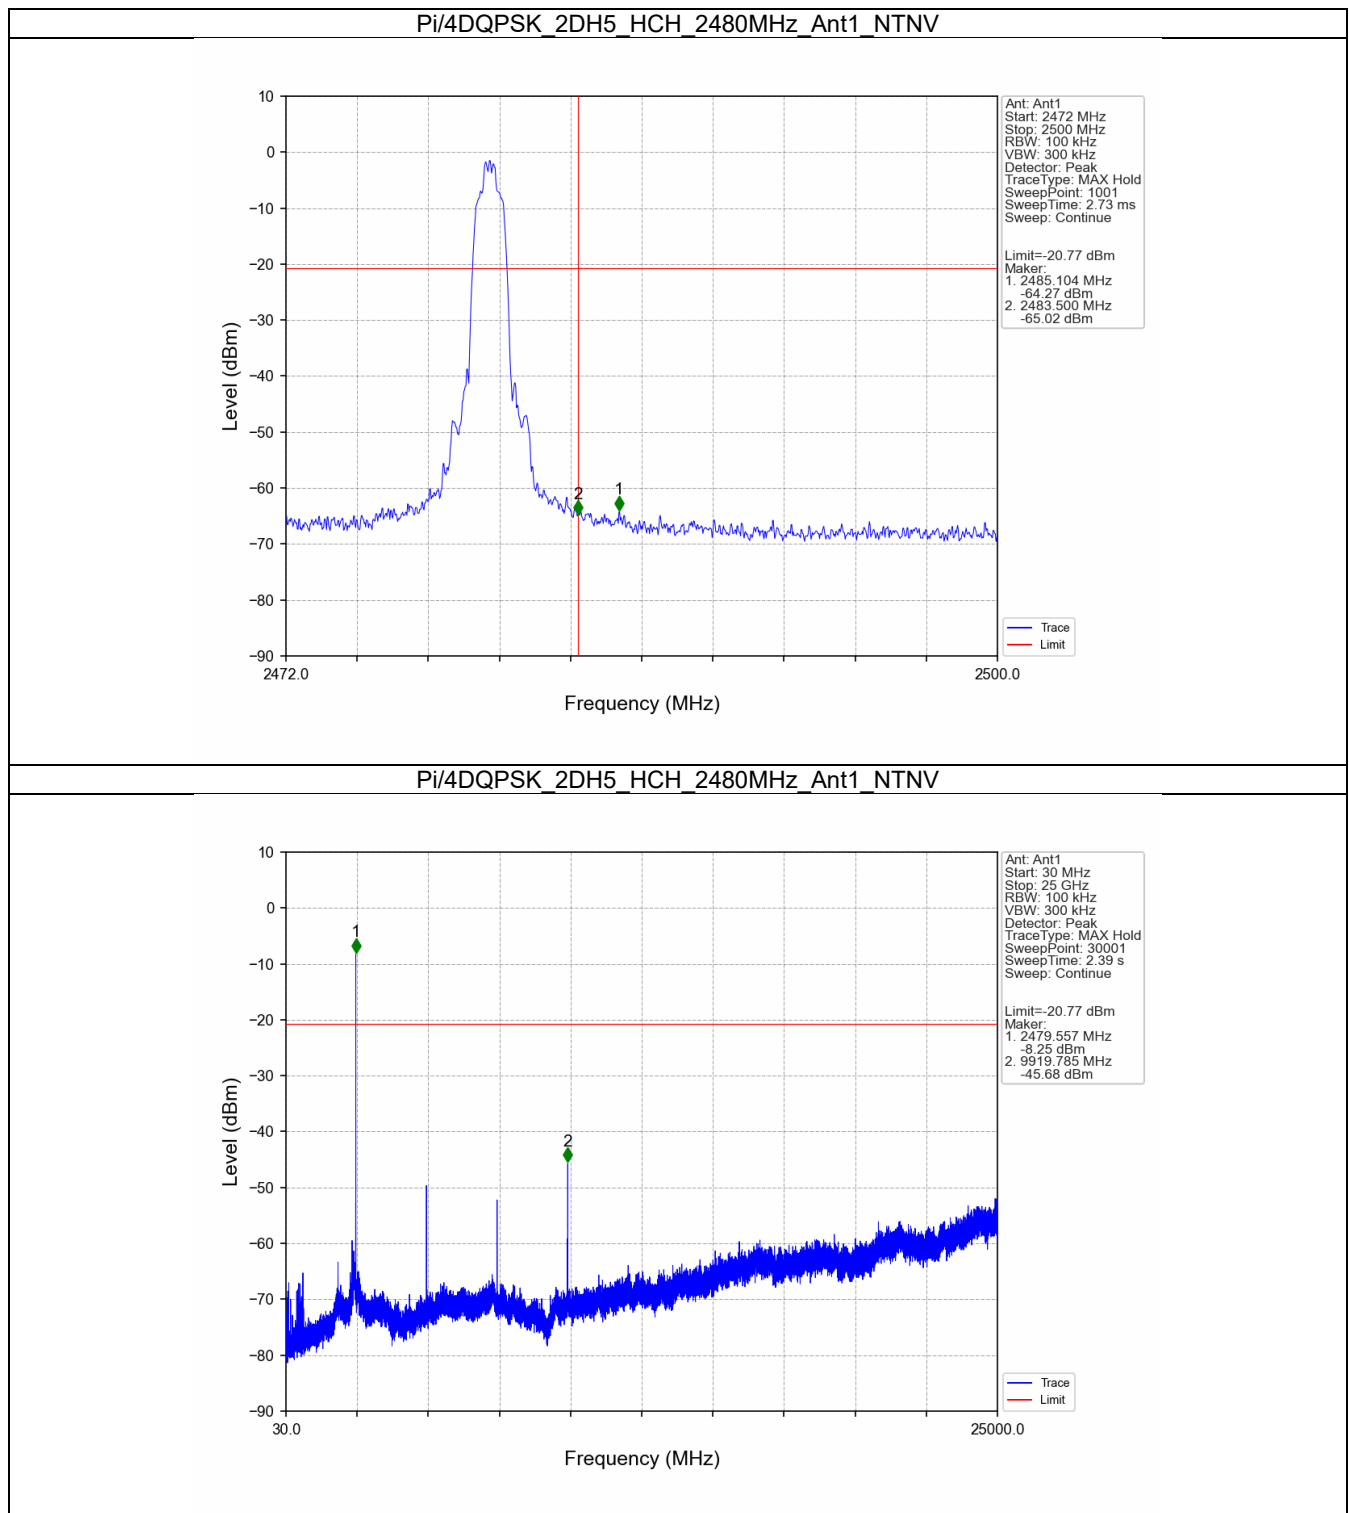


FCC ID: 2BDUR-1202260

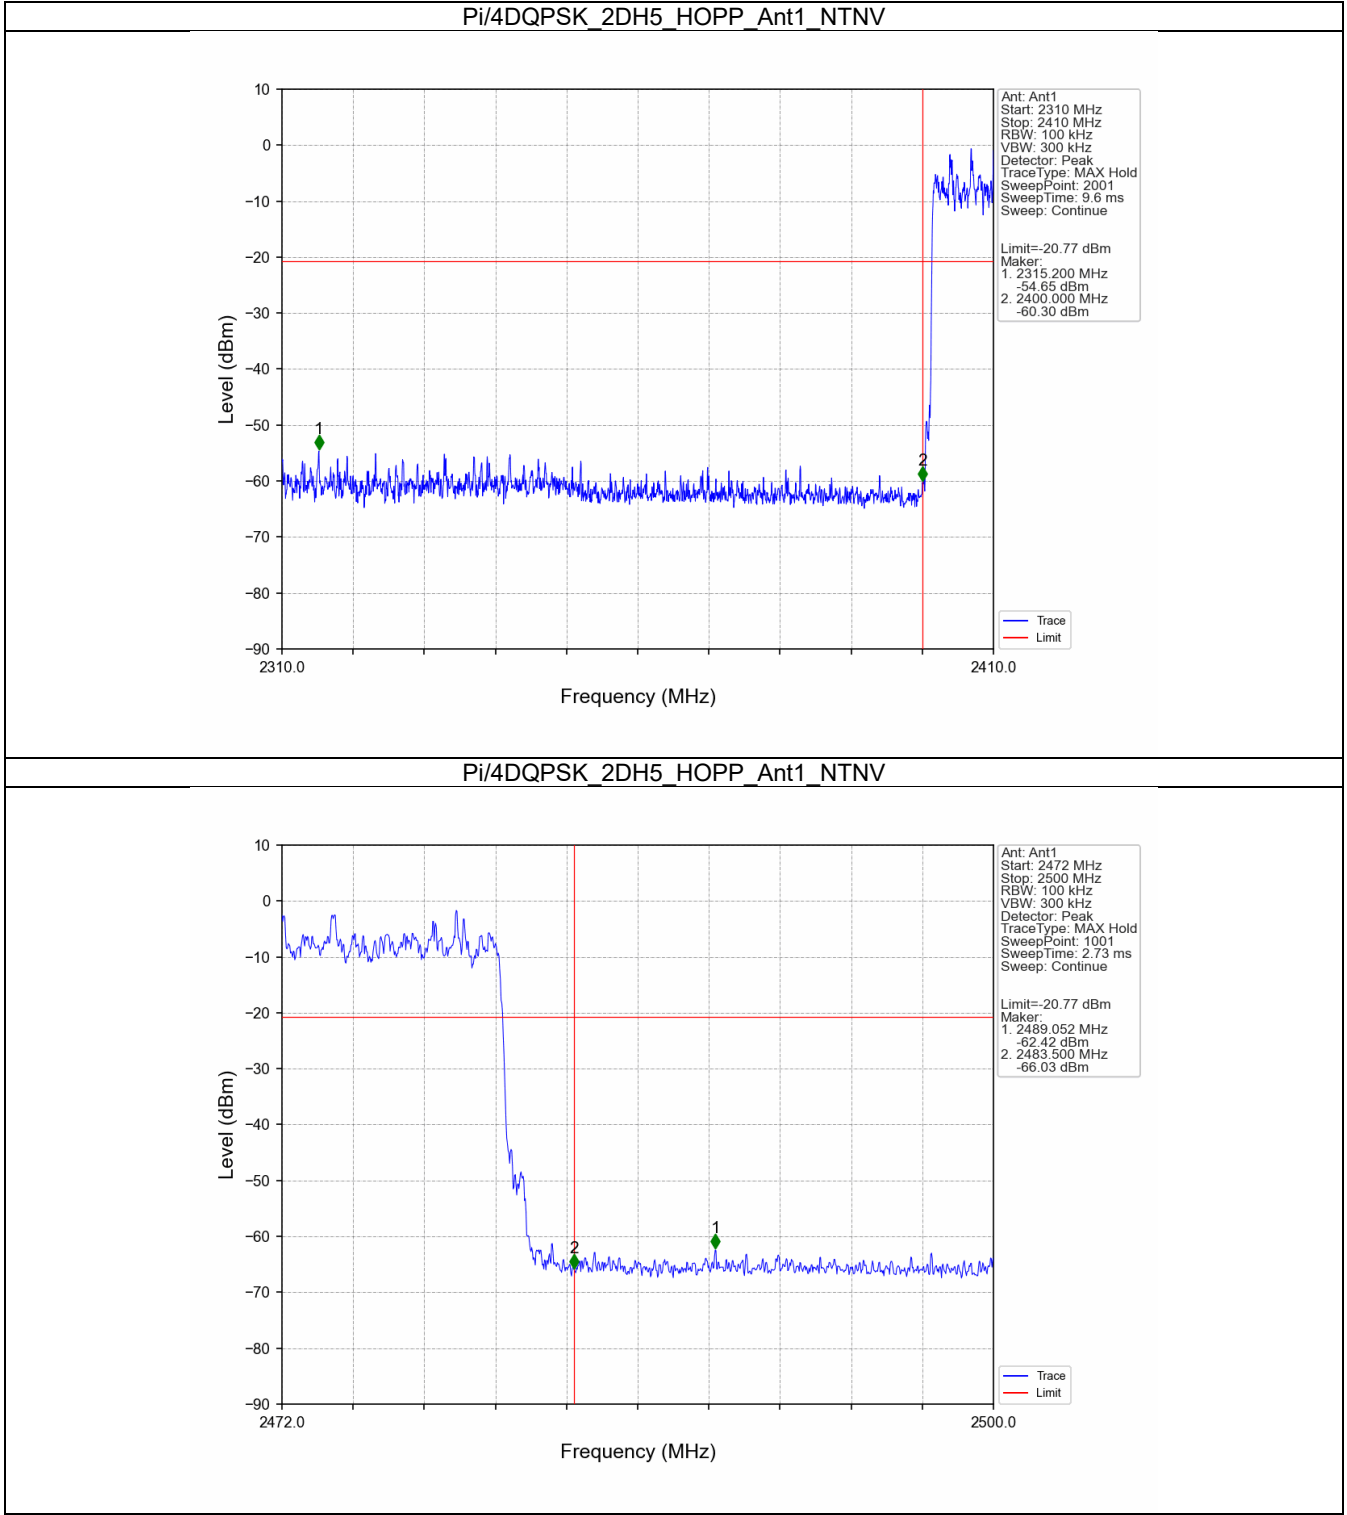


FCC ID: 2BDUR-1202260

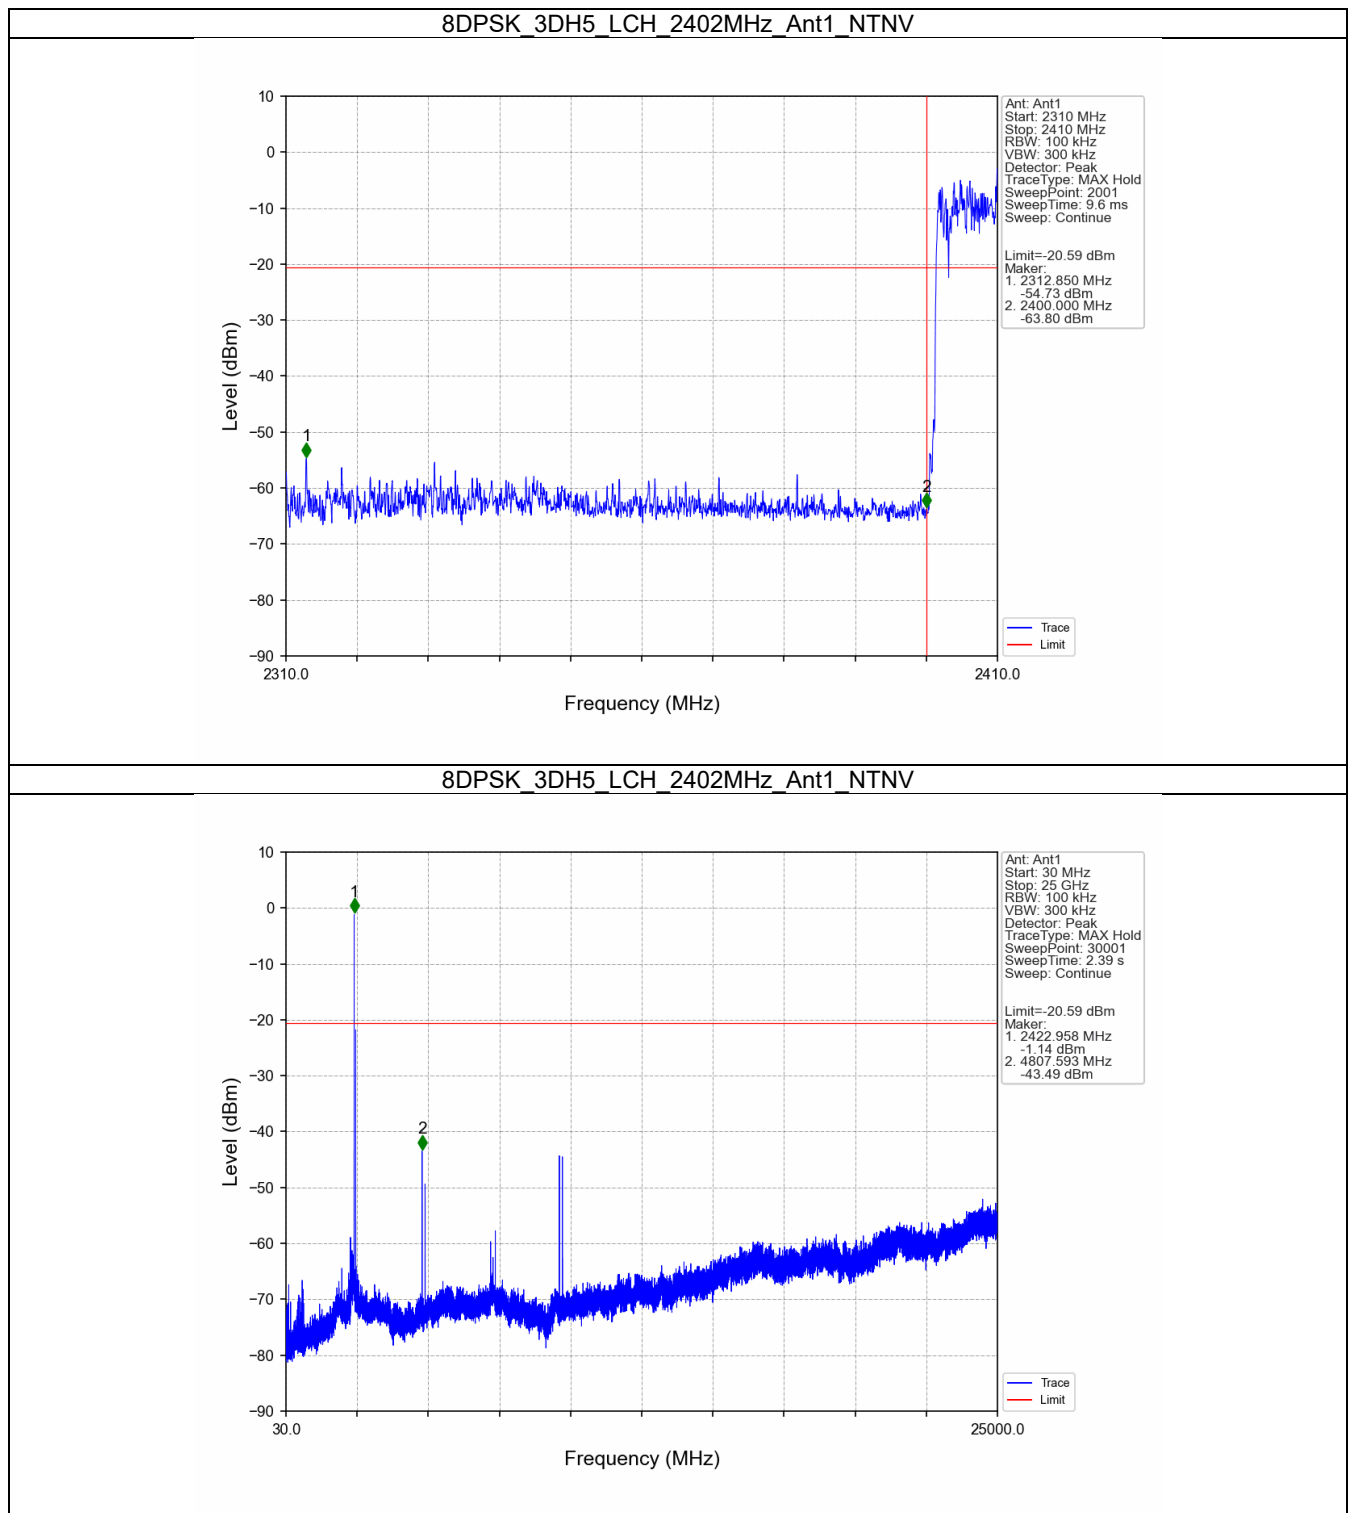

FCC ID: 2BDUR-1202260

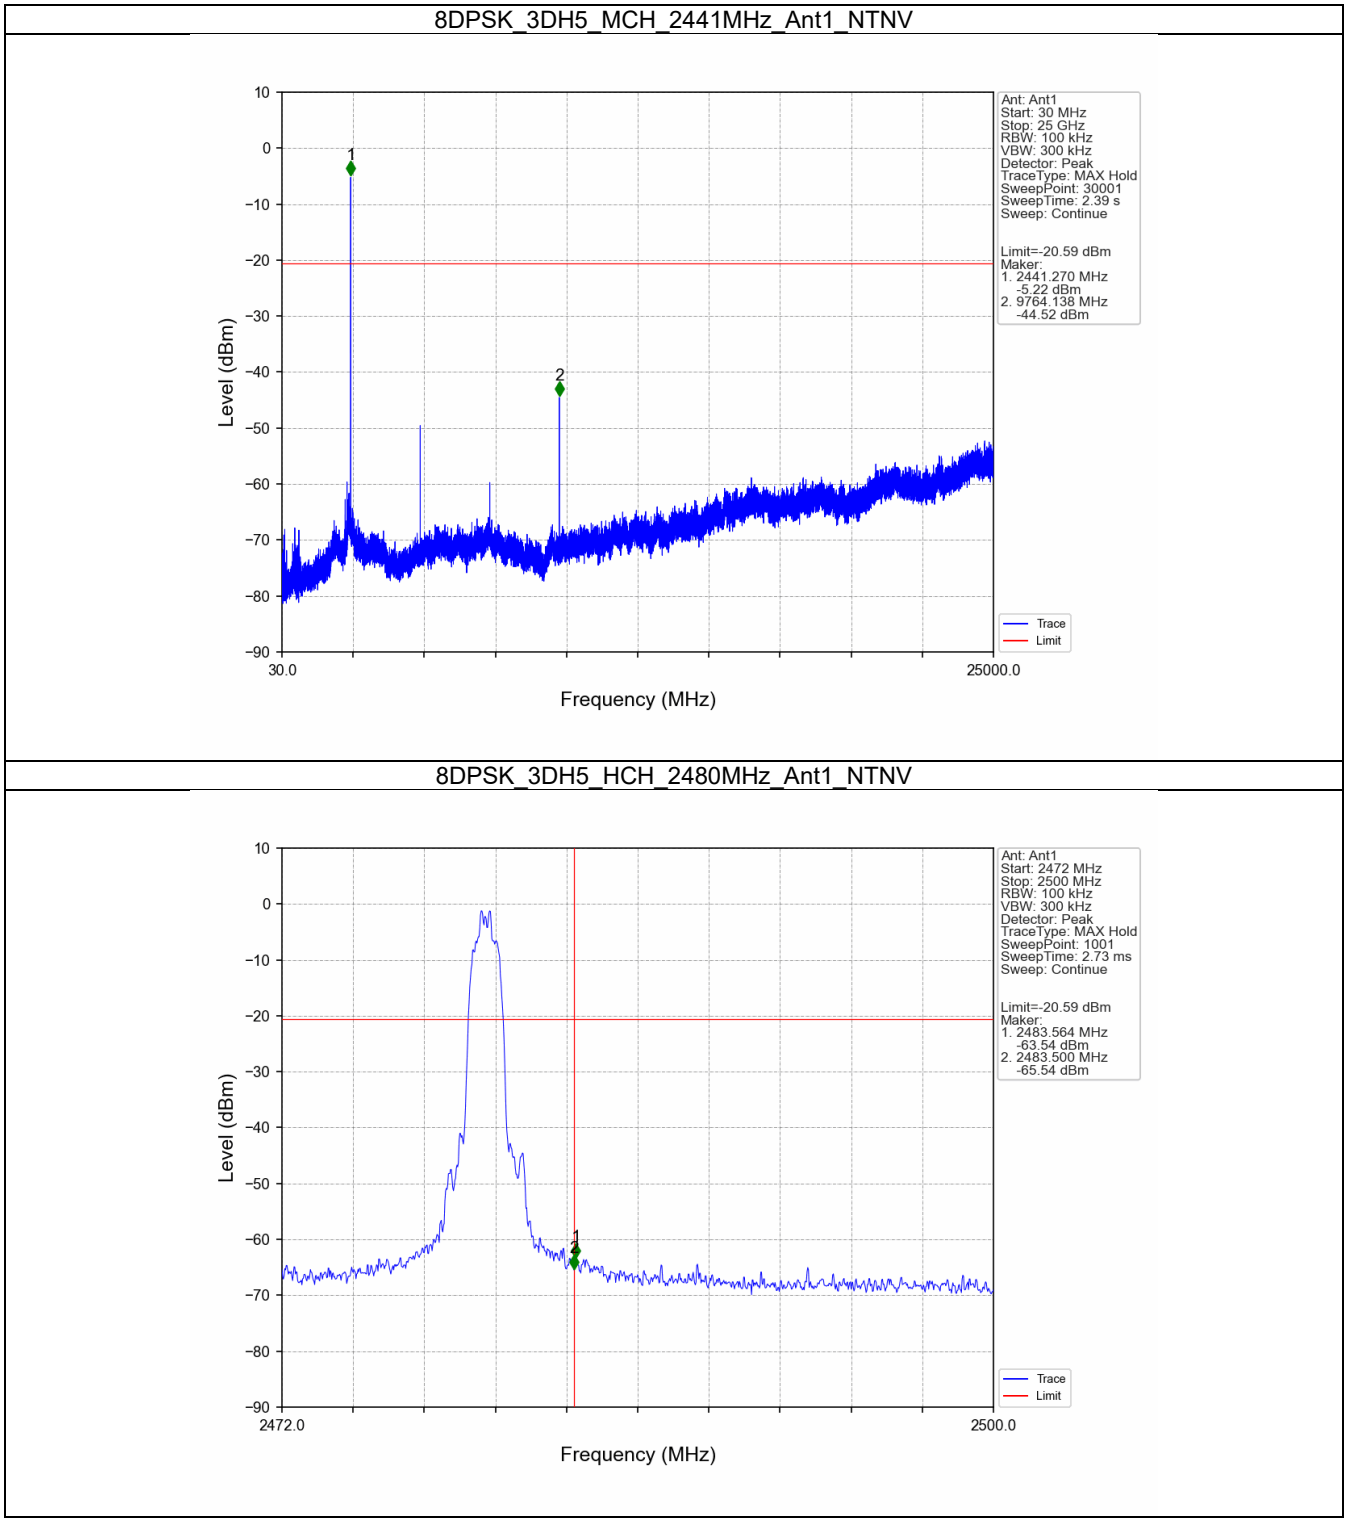

FCC ID: 2BDUR-1202260

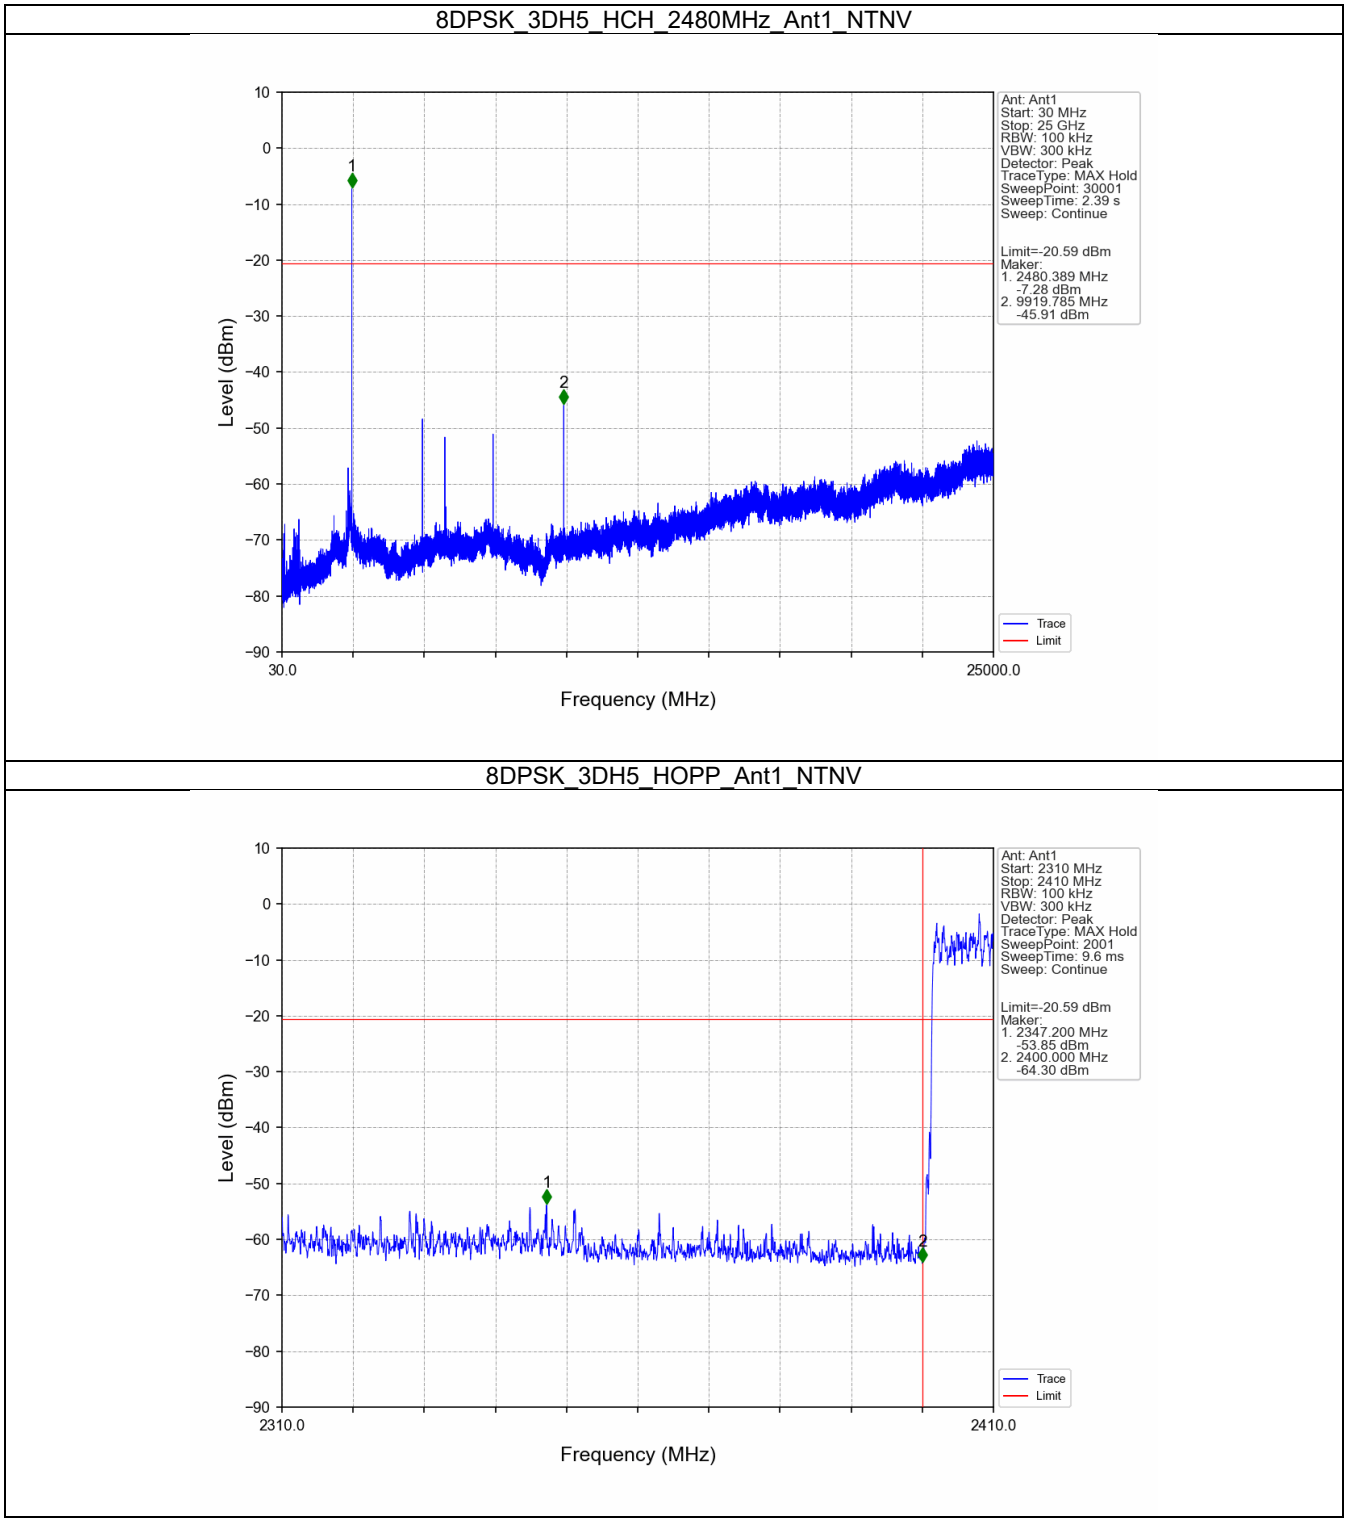

FCC ID: 2BDUR-1202260

