

## Appendix Test Data

Report No.:	1812C50322812504	Test Sample No.:	1-2-2
Start Test Date:	2025-6-30	Finish Test Date:	2025-7-11
Test Engineer:	<i>dylan. Ma</i>	Auditor:	<i>Justin Feng</i>
Temperature:	26.0°C	Relative Humidity:	51%
Pressure:	101kPa		

## Appendix A1: 26dB Bandwidth

### Test Result

Test Mode	Antenna	Frequency [MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.72	5171.20	5188.92	---	---
11A	Ant1	5200	17.80	5191.12	5208.92	---	---
11A	Ant1	5240	17.64	5231.16	5248.80	---	---
11A	Ant1	5260	17.56	5251.16	5268.72	---	---
11A	Ant1	5280	17.44	5271.28	5288.72	---	---
11A	Ant1	5320	17.76	5311.16	5328.92	---	---
11A	Ant1	5500	17.52	5491.20	5508.72	---	---
11A	Ant1	5580	17.68	5571.12	5588.80	---	---
11A	Ant1	5700	17.60	5691.20	5708.80	---	---
11A	Ant1	5745	17.64	5736.16	5753.80	---	---
11A	Ant1	5785	17.64	5776.16	5793.80	---	---
11A	Ant1	5825	17.56	5816.16	5833.72	---	---
11N20SISO	Ant1	5180	18.48	5170.76	5189.24	---	---
11N20SISO	Ant1	5200	18.36	5190.84	5209.20	---	---
11N20SISO	Ant1	5240	18.44	5230.80	5249.24	---	---
11N20SISO	Ant1	5260	18.44	5250.80	5269.24	---	---
11N20SISO	Ant1	5280	18.44	5270.80	5289.24	---	---
11N20SISO	Ant1	5320	18.40	5310.80	5329.20	---	---
11N20SISO	Ant1	5500	18.44	5490.80	5509.24	---	---
11N20SISO	Ant1	5580	18.48	5570.76	5589.24	---	---
11N20SISO	Ant1	5700	18.44	5690.80	5709.24	---	---
11N20SISO	Ant1	5745	18.40	5735.80	5754.20	---	---
11N20SISO	Ant1	5785	18.44	5775.80	5794.24	---	---
11N20SISO	Ant1	5825	18.44	5815.76	5834.20	---	---
11N40SISO	Ant1	5190	38.32	5170.80	5209.12	---	---

11N40SISO	Ant1	5230	38.16	5210.88	5249.04	---	---
11N40SISO	Ant1	5270	38.40	5250.72	5289.12	---	---
11N40SISO	Ant1	5310	38.16	5290.88	5329.04	---	---
11N40SISO	Ant1	5510	38.16	5490.80	5528.96	---	---
11N40SISO	Ant1	5550	38.24	5530.80	5569.04	---	---
11N40SISO	Ant1	5670	38.16	5650.80	5688.96	---	---
11N40SISO	Ant1	5755	38.16	5735.80	5773.96	---	---
11N40SISO	Ant1	5795	38.24	5775.80	5814.04	---	---
11AC20SISO	Ant1	5180	18.68	5170.60	5189.28	---	---
11AC20SISO	Ant1	5200	18.84	5190.52	5209.36	---	---
11AC20SISO	Ant1	5240	18.84	5230.52	5249.36	---	---
11AC20SISO	Ant1	5260	18.56	5250.72	5269.28	---	---
11AC20SISO	Ant1	5280	18.72	5270.64	5289.36	---	---
11AC20SISO	Ant1	5320	18.68	5310.60	5329.28	---	---
11AC20SISO	Ant1	5500	18.76	5490.60	5509.36	---	---
11AC20SISO	Ant1	5580	18.88	5570.44	5589.32	---	---
11AC20SISO	Ant1	5700	18.92	5690.44	5709.36	---	---
11AC20SISO	Ant1	5745	18.76	5735.60	5754.36	---	---
11AC20SISO	Ant1	5785	18.84	5775.52	5794.36	---	---
11AC20SISO	Ant1	5825	18.64	5815.60	5834.24	---	---
11AC40SISO	Ant1	5190	38.24	5170.88	5209.12	---	---
11AC40SISO	Ant1	5230	38.64	5210.72	5249.36	---	---
11AC40SISO	Ant1	5270	38.24	5250.88	5289.12	---	---
11AC40SISO	Ant1	5310	38.40	5290.96	5329.36	---	---
11AC40SISO	Ant1	5510	38.24	5490.88	5529.12	---	---
11AC40SISO	Ant1	5550	38.56	5530.80	5569.36	---	---
11AC40SISO	Ant1	5670	38.08	5650.88	5688.96	---	---
11AC40SISO	Ant1	5755	38.32	5735.80	5774.12	---	---
11AC40SISO	Ant1	5795	38.32	5775.72	5814.04	---	---
11AX20SISO	Ant1	5180	19.76	5170.08	5189.84	---	---
11AX20SISO	Ant1	5200	19.92	5190.04	5209.96	---	---
11AX20SISO	Ant1	5240	19.92	5230.08	5250.00	---	---
11AX20SISO	Ant1	5260	19.96	5250.04	5270.00	---	---
11AX20SISO	Ant1	5280	19.96	5270.04	5290.00	---	---
11AX20SISO	Ant1	5320	19.80	5310.12	5329.92	---	---
11AX20SISO	Ant1	5500	19.84	5490.12	5509.96	---	---
11AX20SISO	Ant1	5580	19.80	5570.12	5589.92	---	---
11AX20SISO	Ant1	5700	19.88	5690.04	5709.92	---	---
11AX20SISO	Ant1	5745	19.80	5735.04	5754.84	---	---
11AX20SISO	Ant1	5785	19.96	5775.04	5795.00	---	---
11AX20SISO	Ant1	5825	19.92	5815.08	5835.00	---	---
11AX40SISO	Ant1	5190	39.60	5170.16	5209.76	---	---


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

11AX40SISO	Ant1	5230	39.60	5210.16	5249.76	---	---
11AX40SISO	Ant1	5270	39.36	5250.24	5289.60	---	---
11AX40SISO	Ant1	5310	39.52	5290.24	5329.76	---	---
11AX40SISO	Ant1	5510	39.44	5490.16	5529.60	---	---
11AX40SISO	Ant1	5550	39.44	5530.16	5569.60	---	---
11AX40SISO	Ant1	5670	39.52	5650.16	5689.68	---	---
11AX40SISO	Ant1	5755	39.44	5735.16	5774.60	---	---
11AX40SISO	Ant1	5795	39.60	5775.08	5814.68	---	---


## Test Graphs

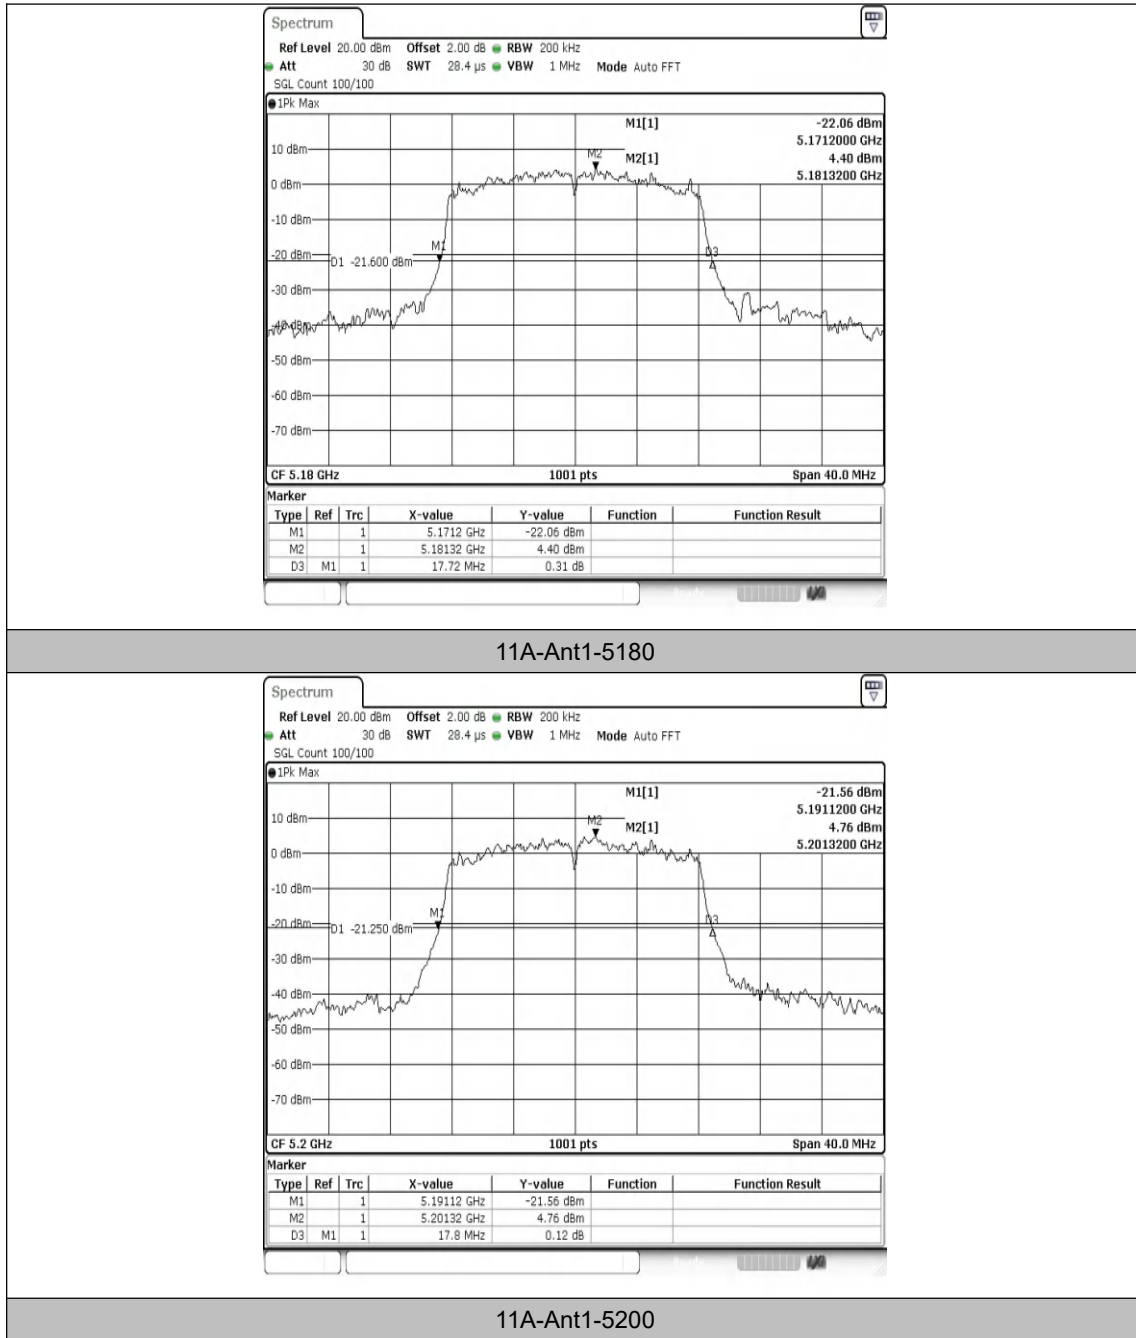



## Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

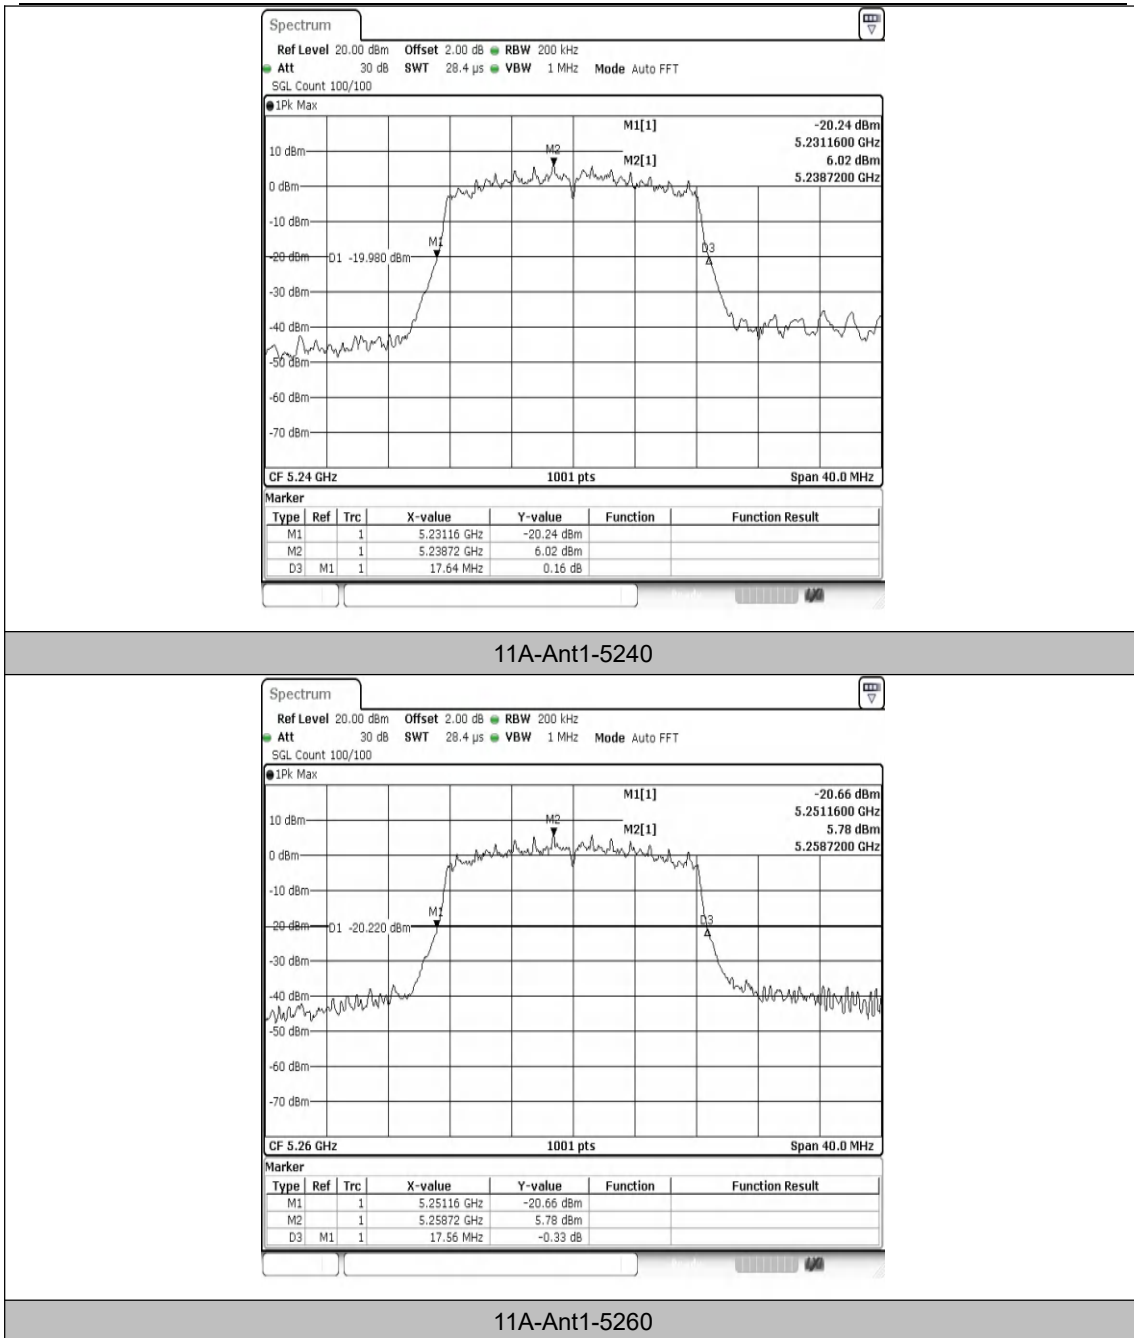

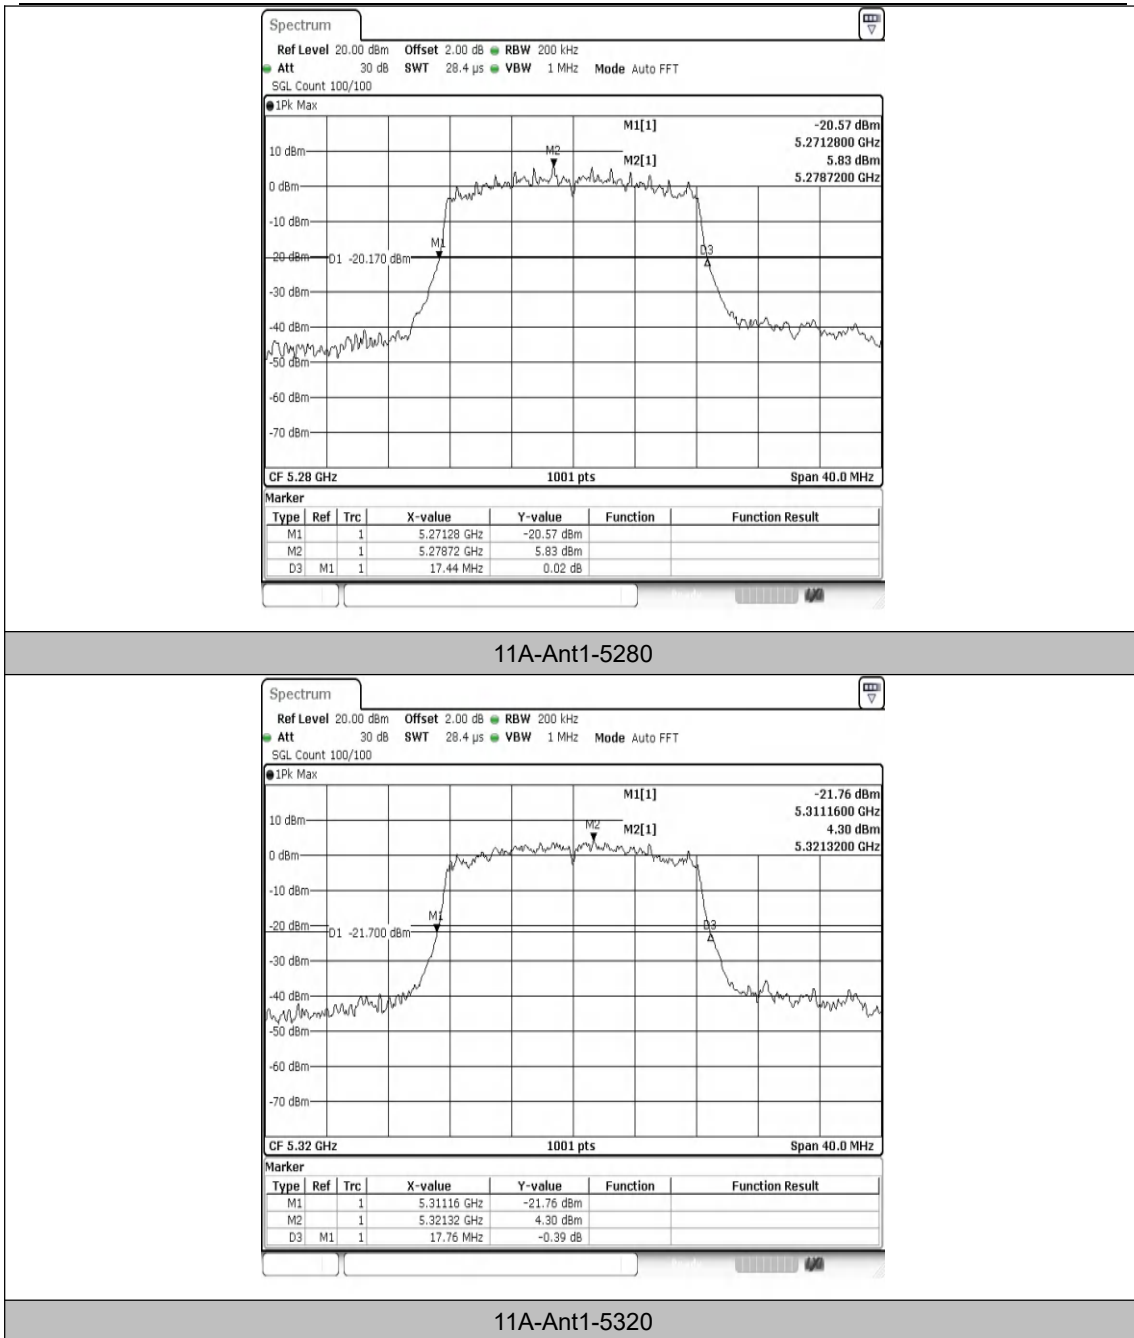


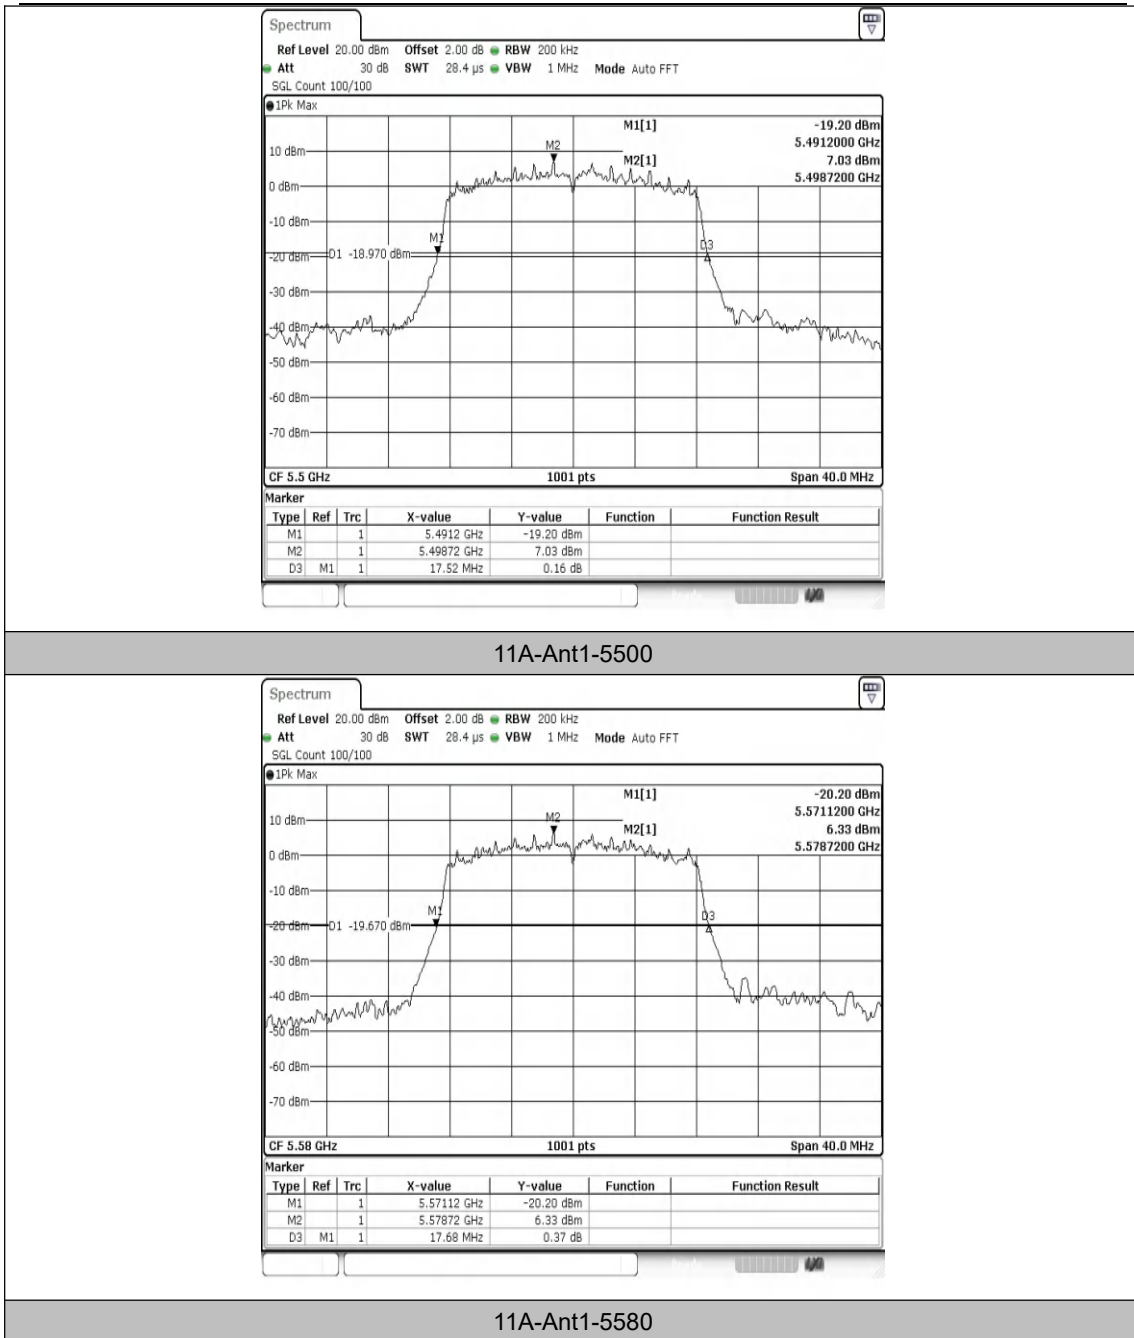



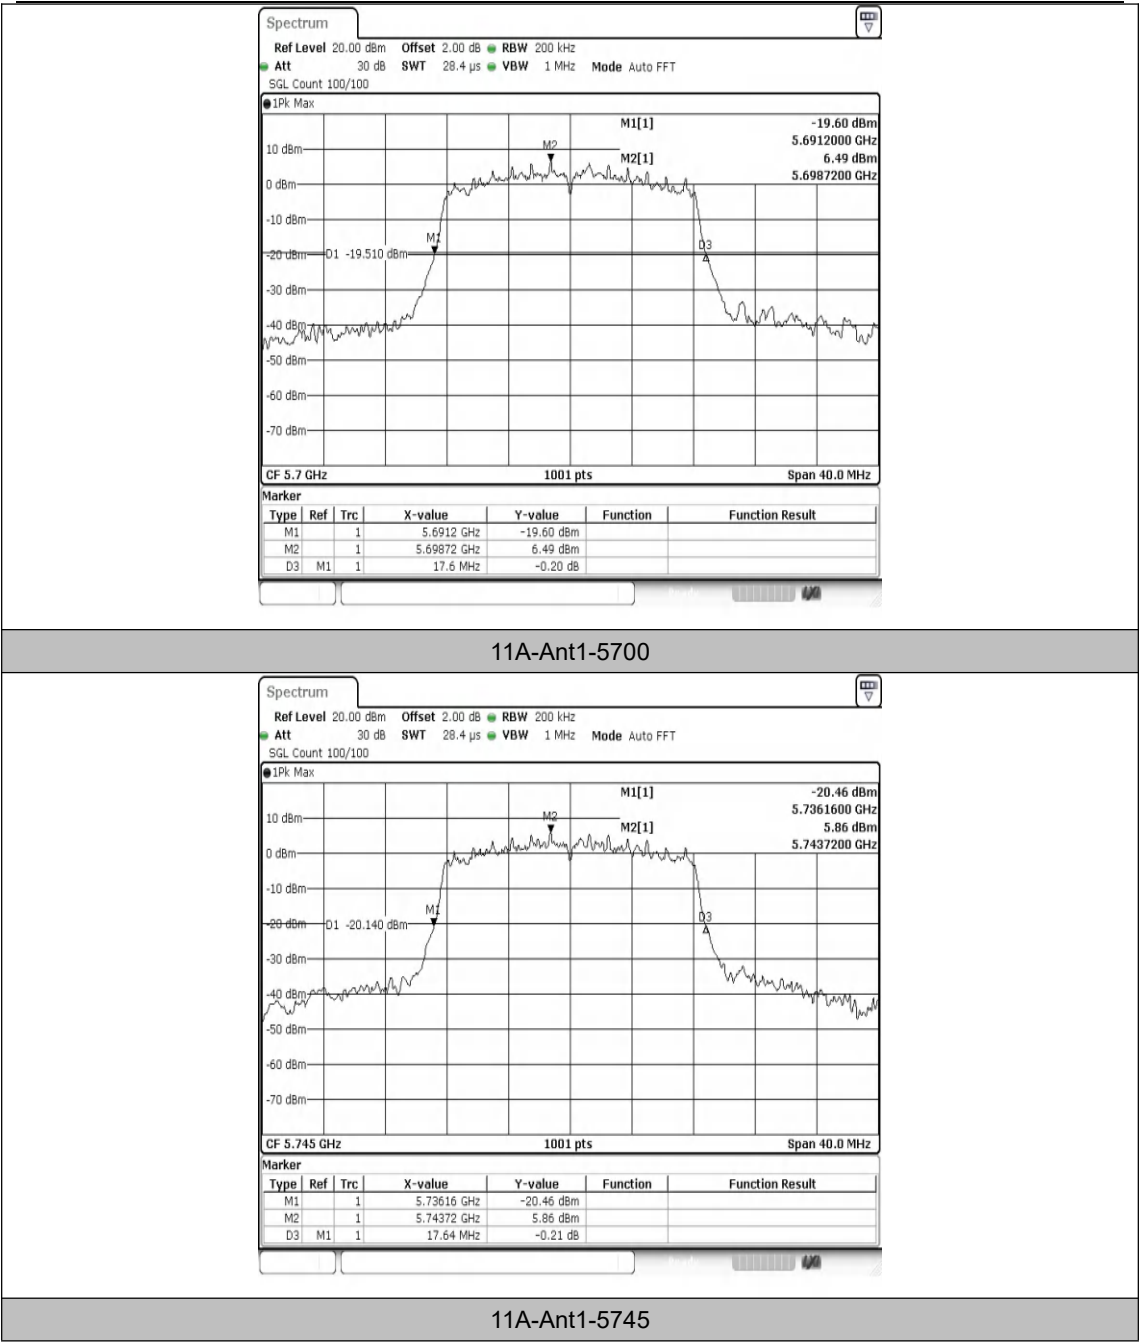




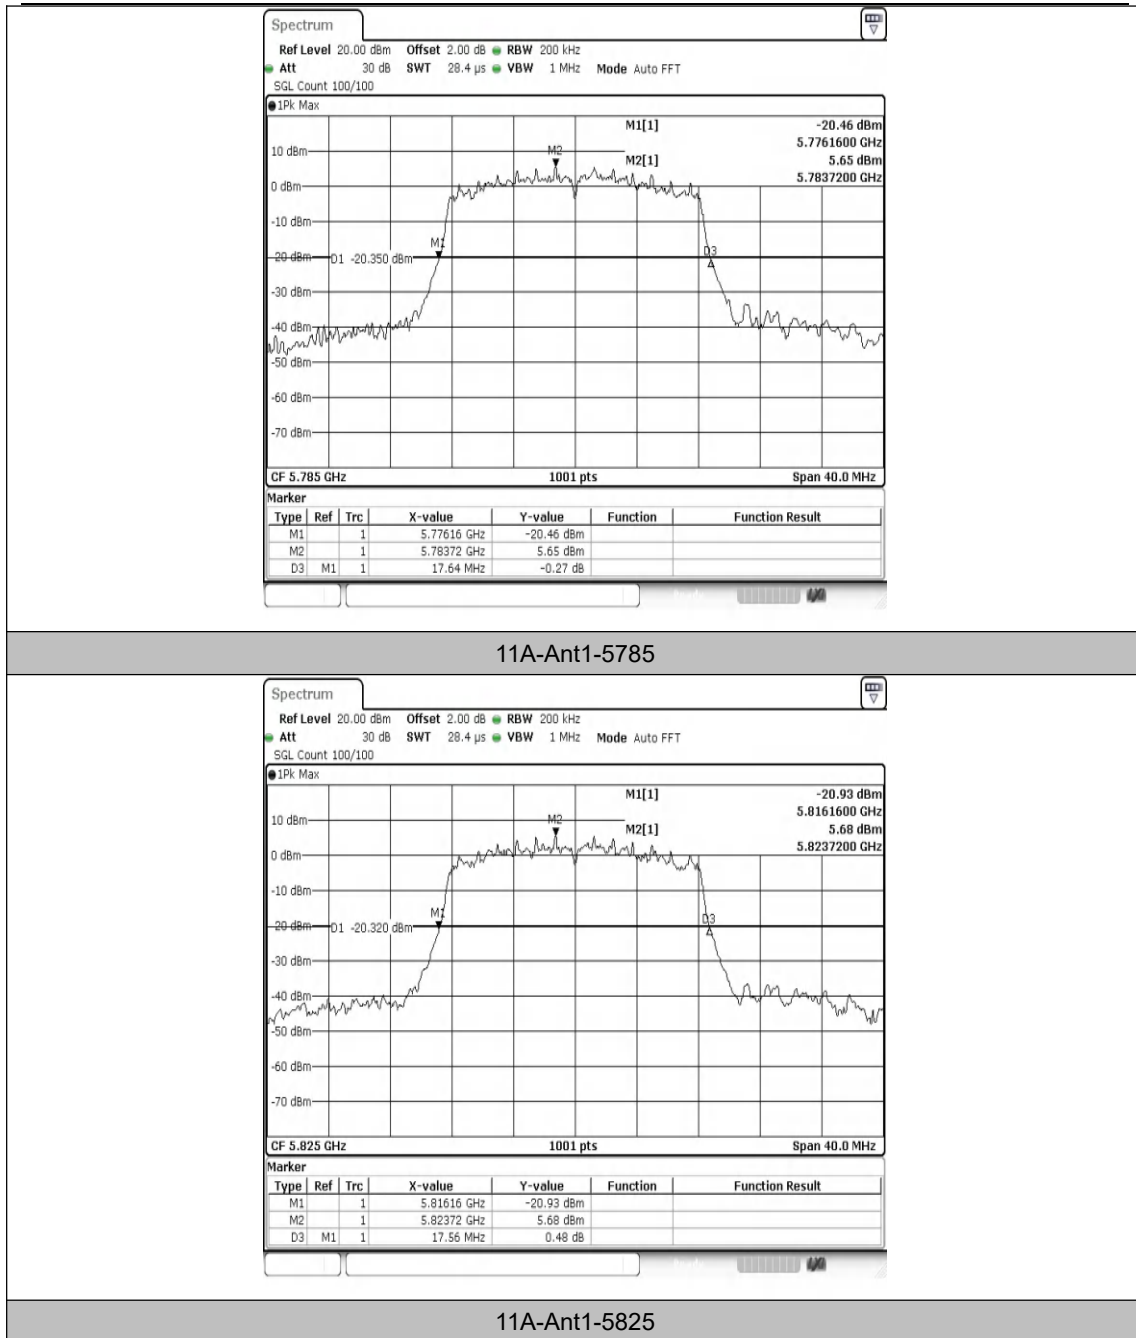


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

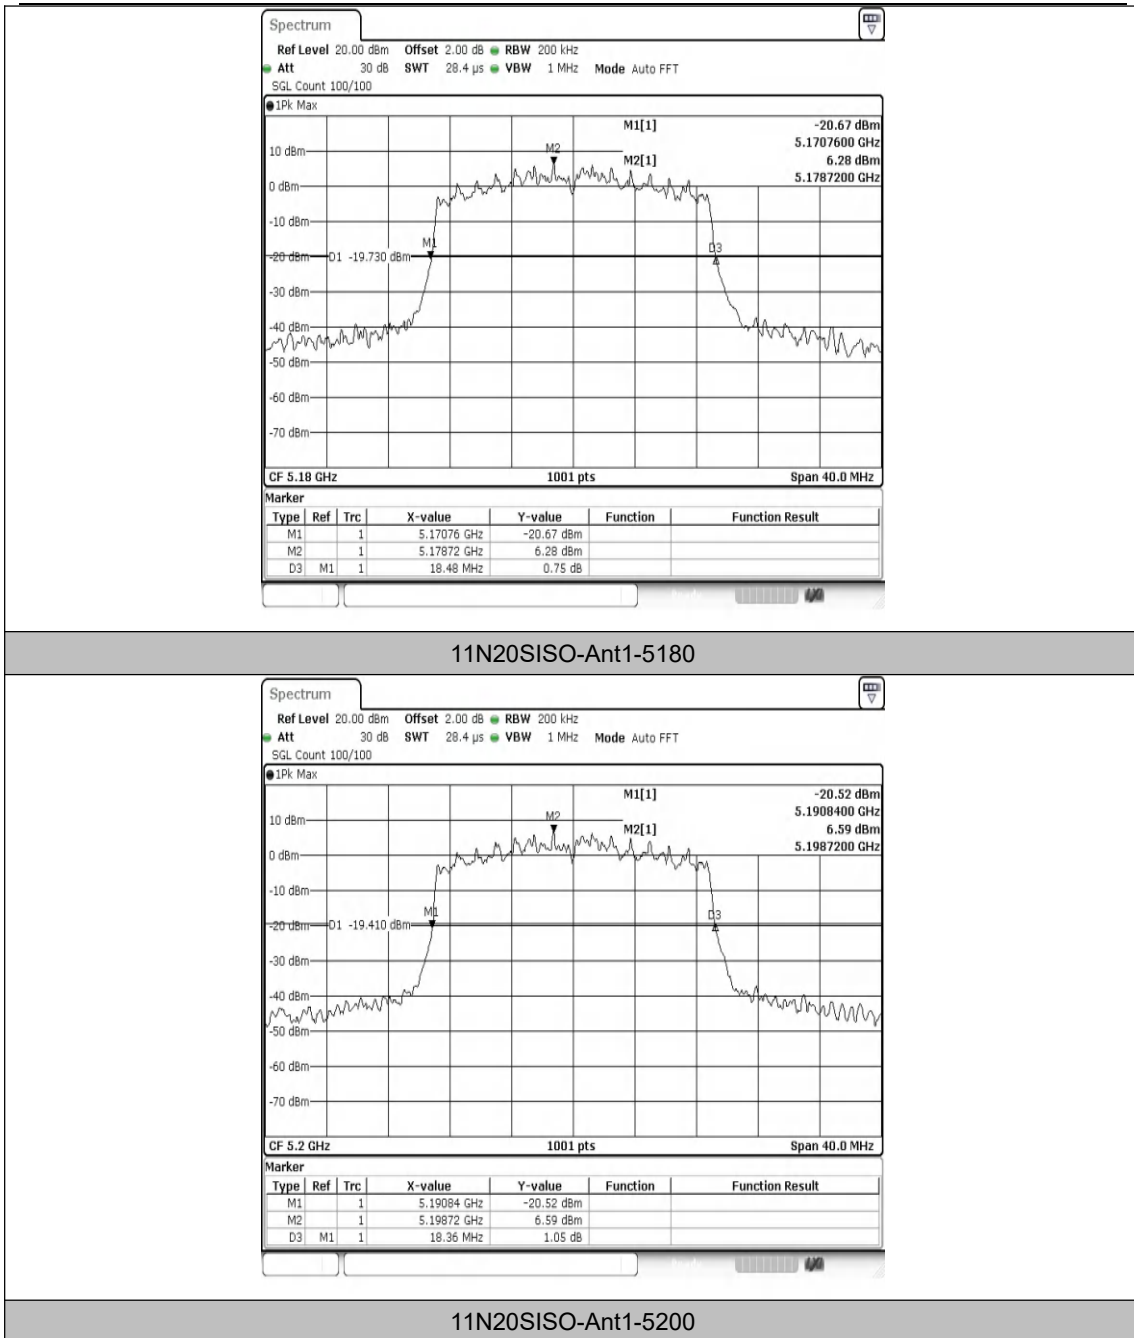


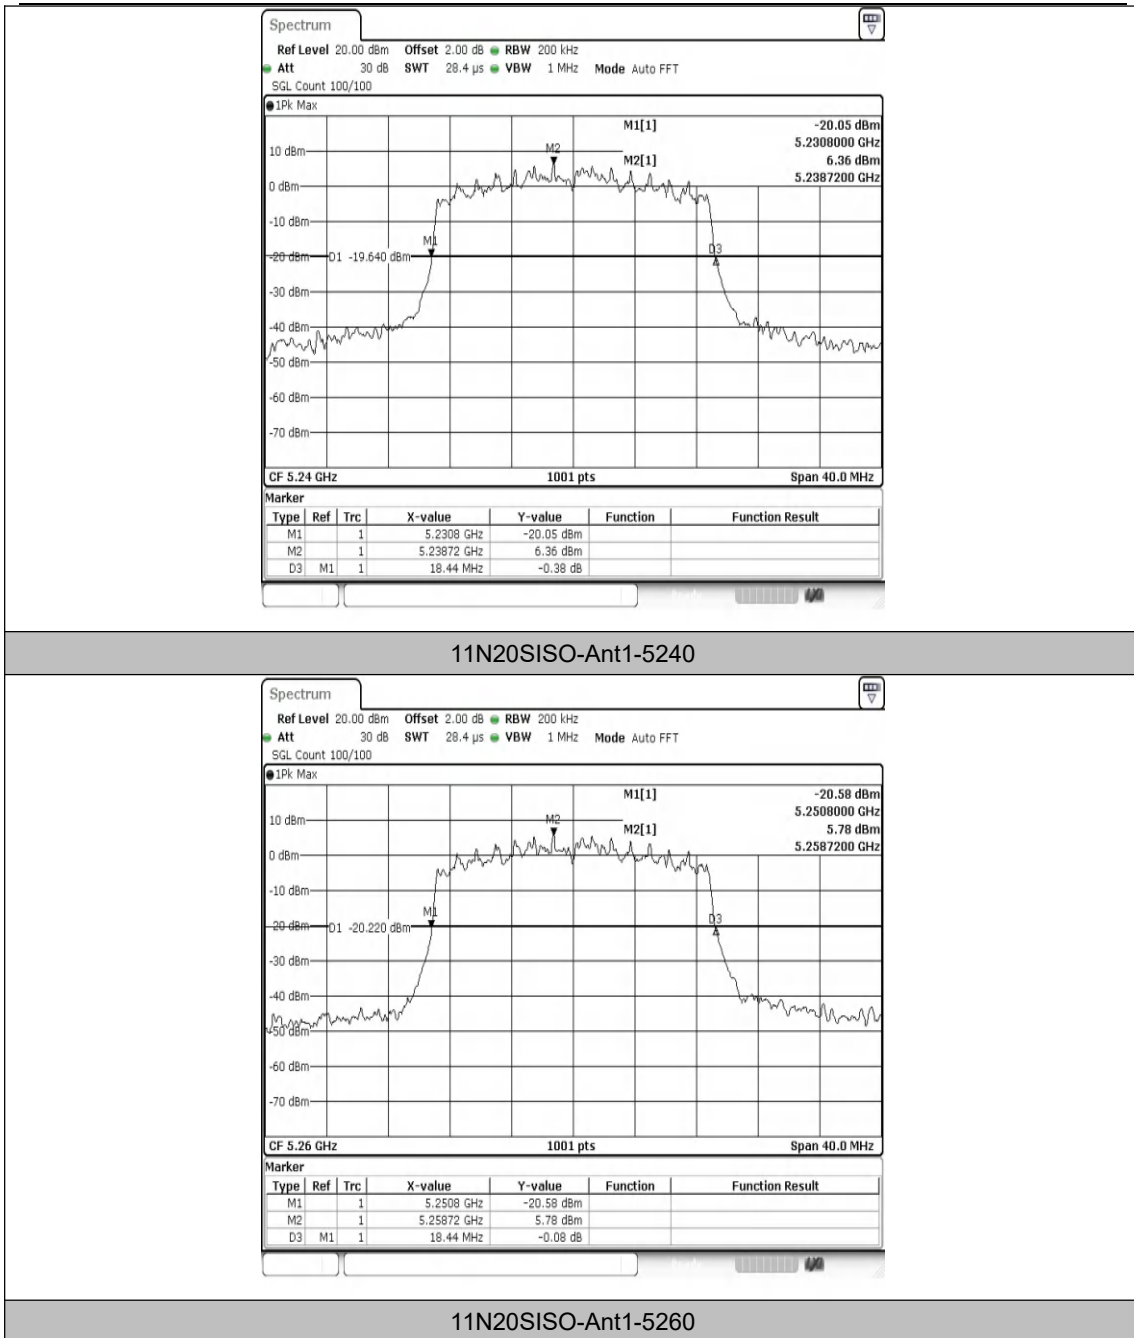



### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

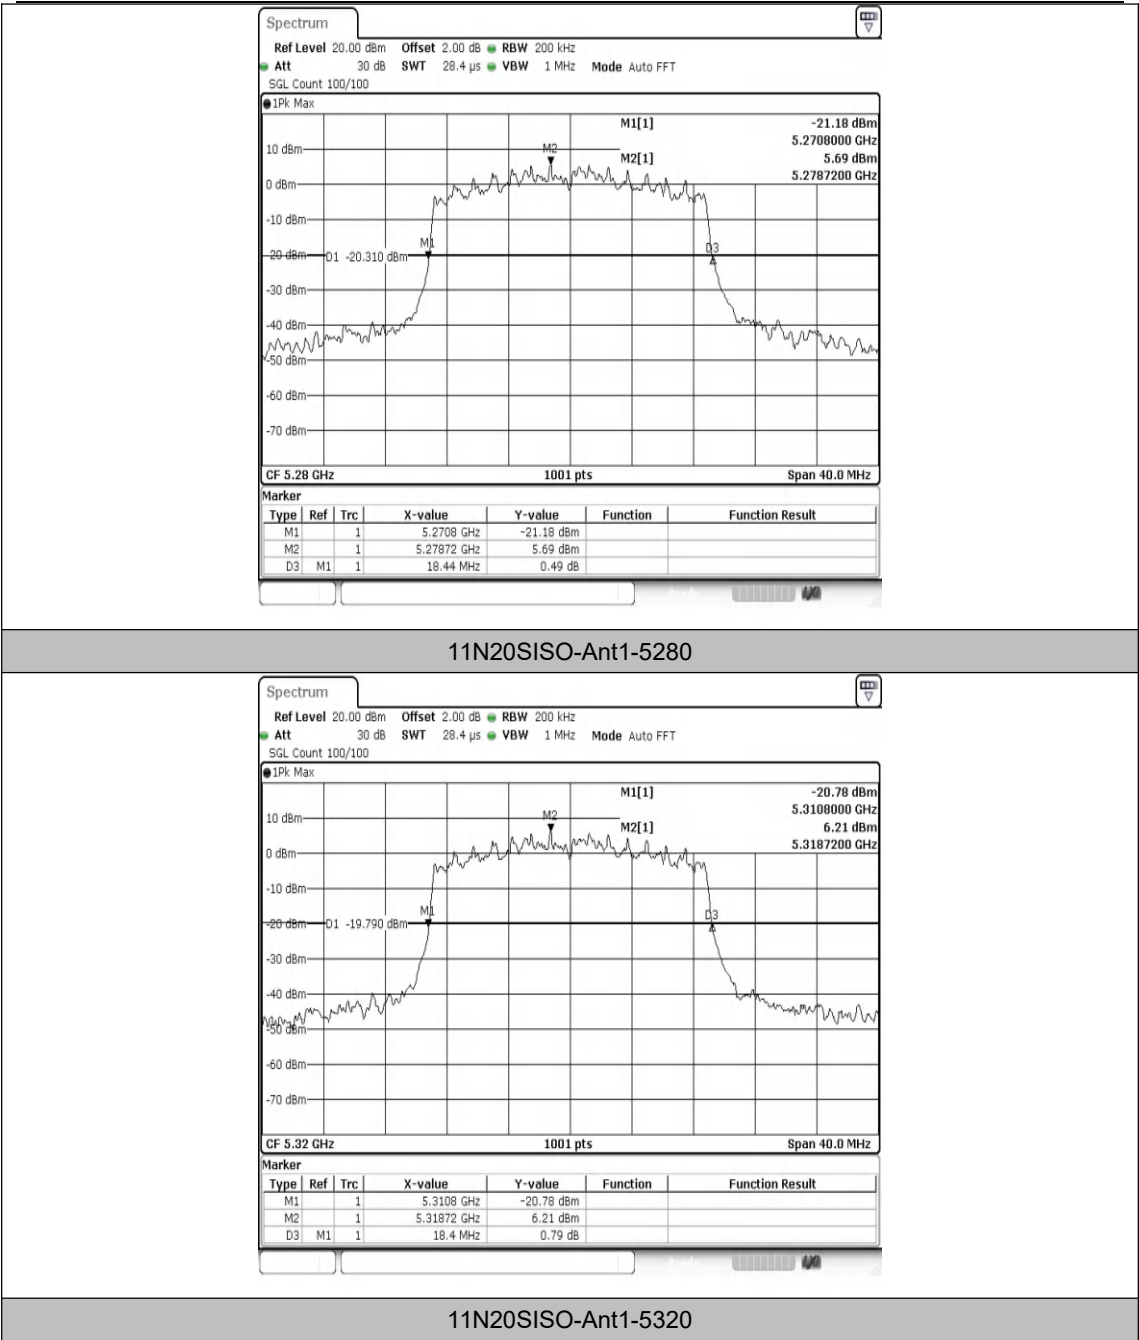


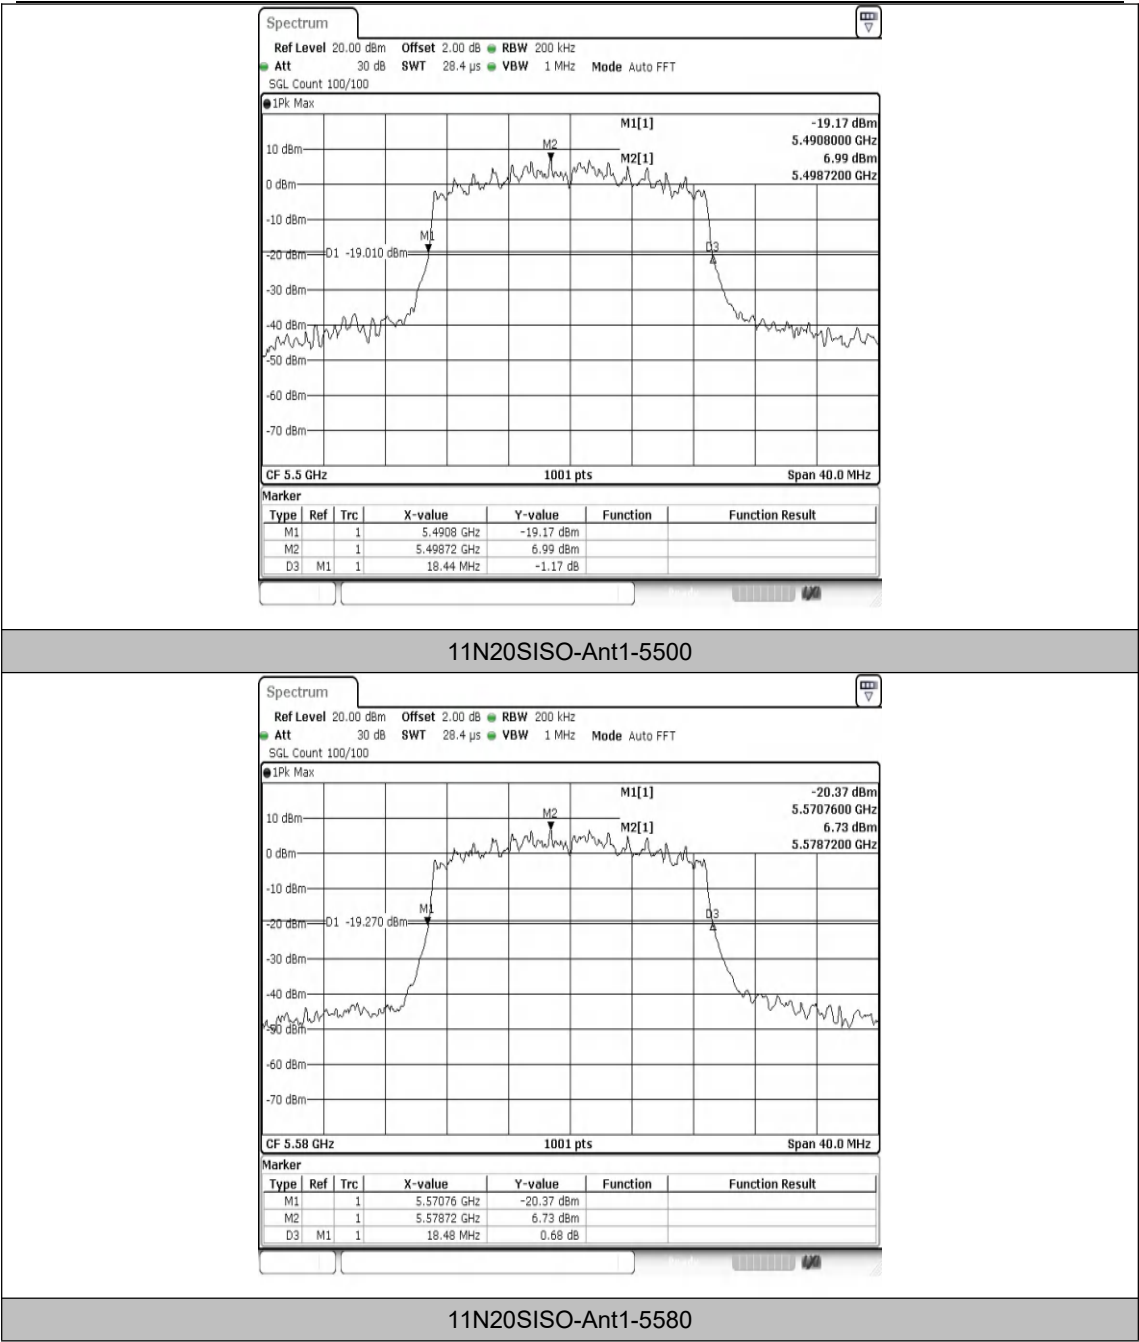


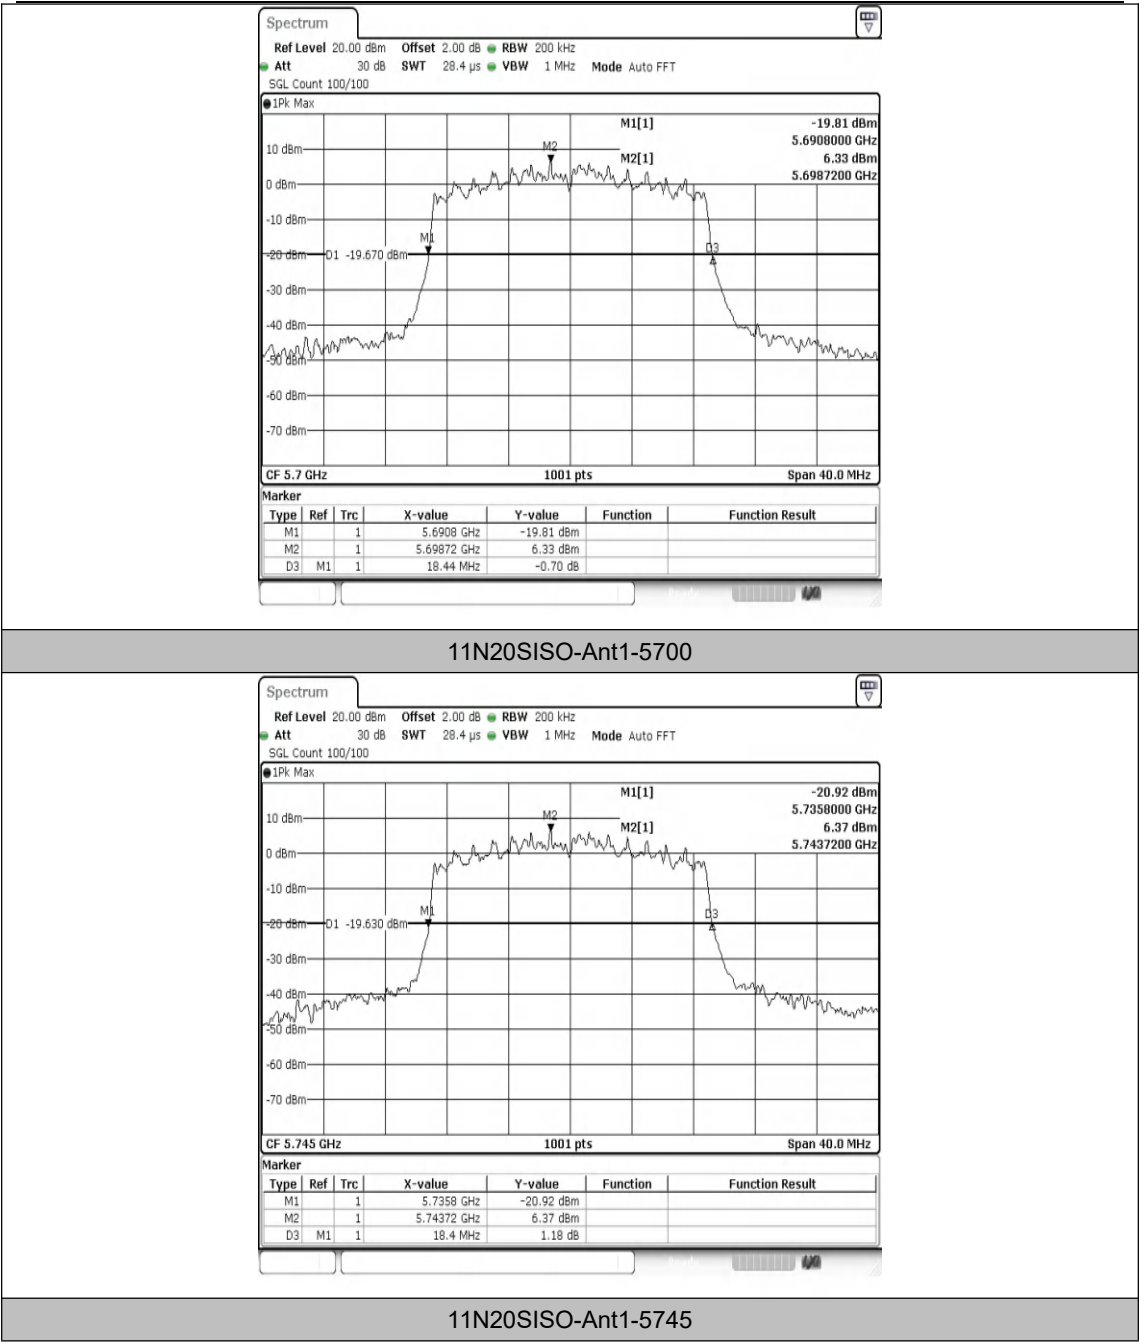


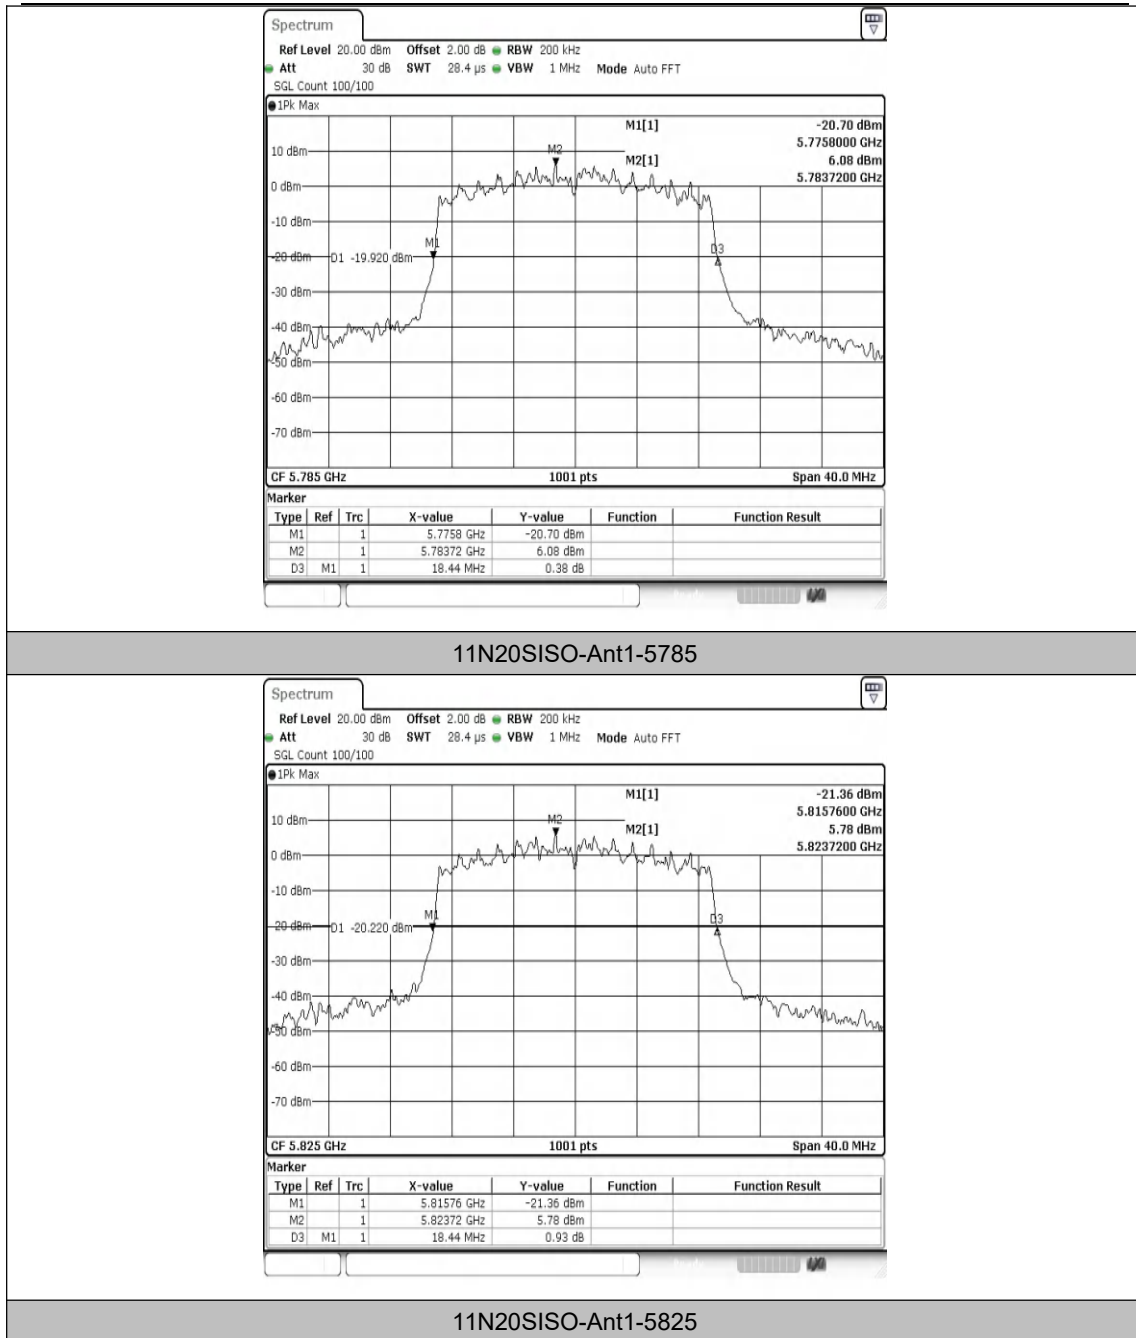



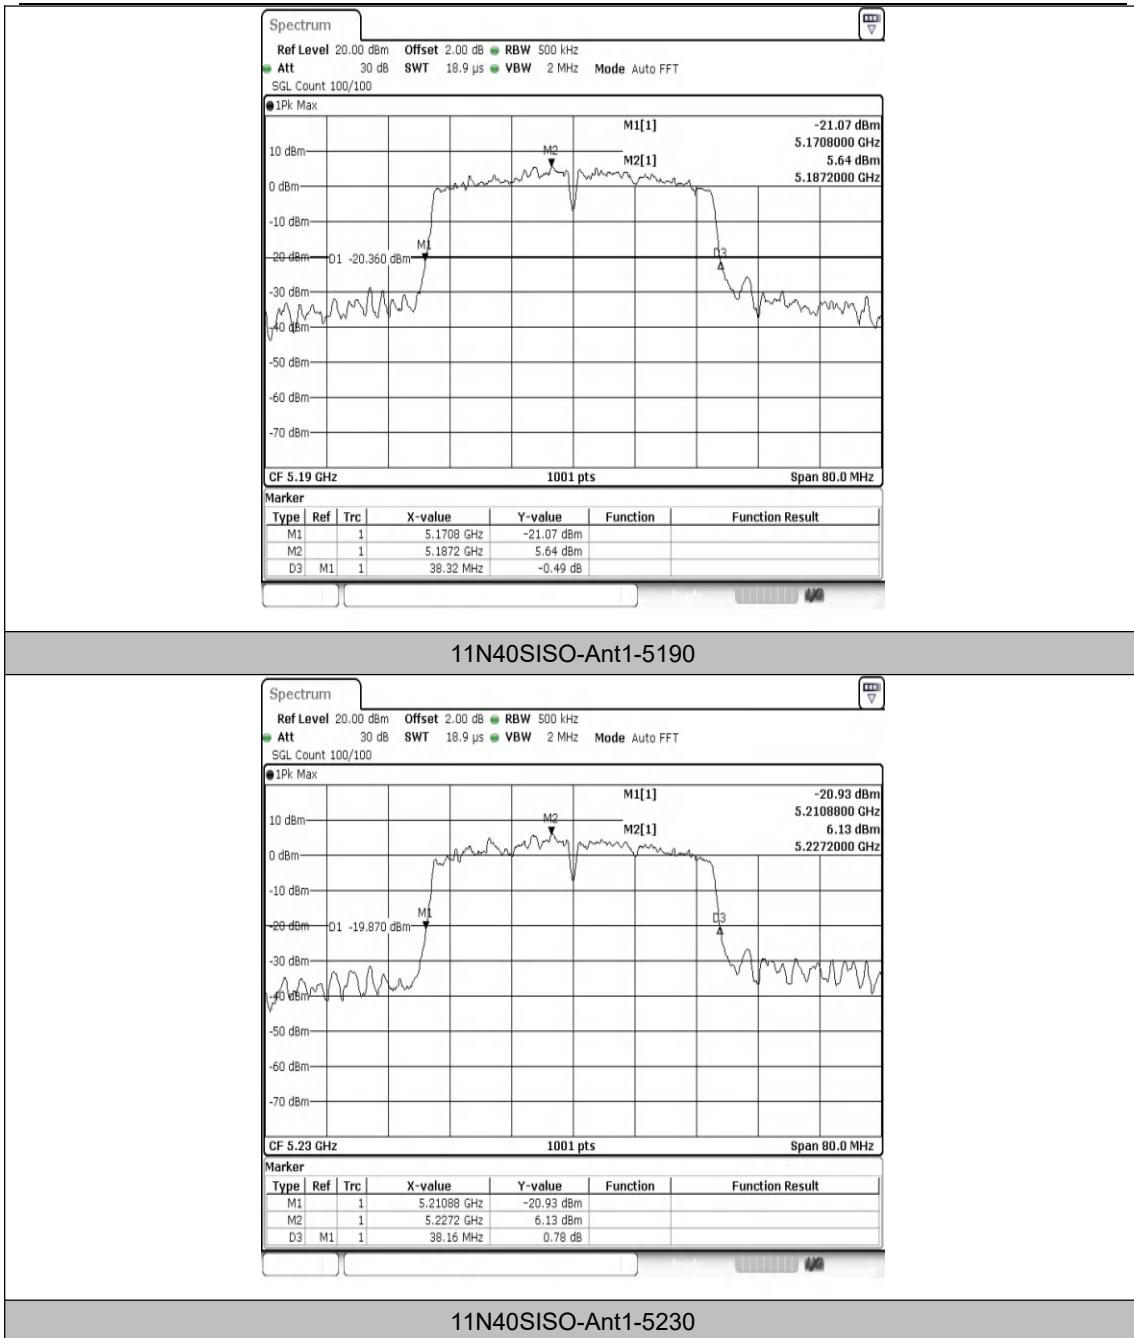

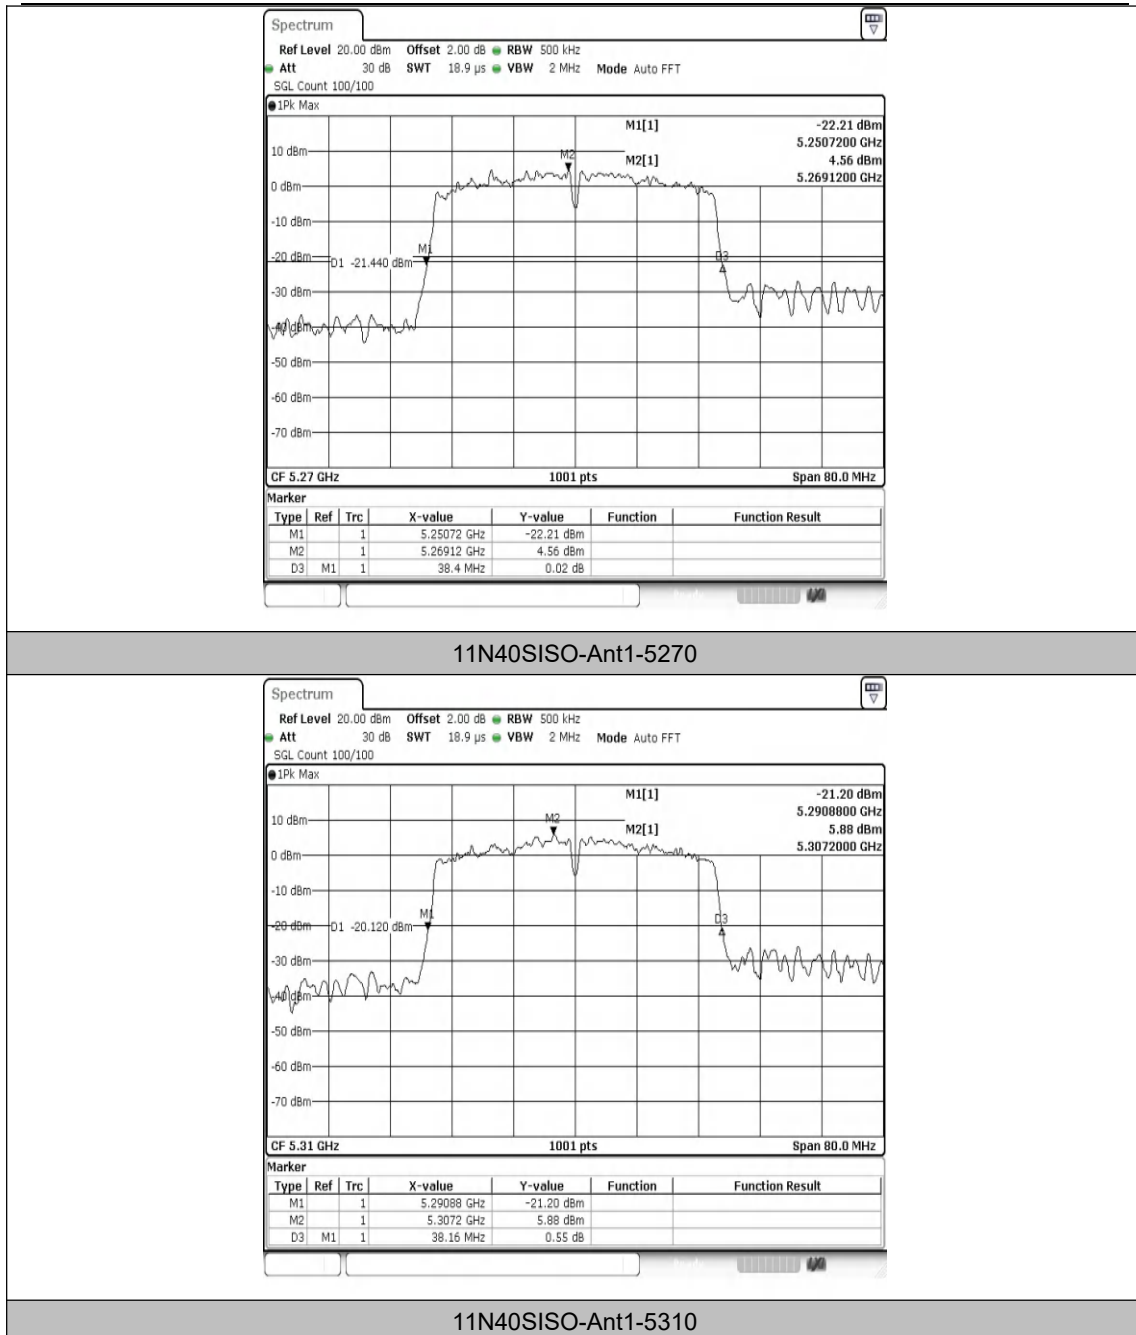


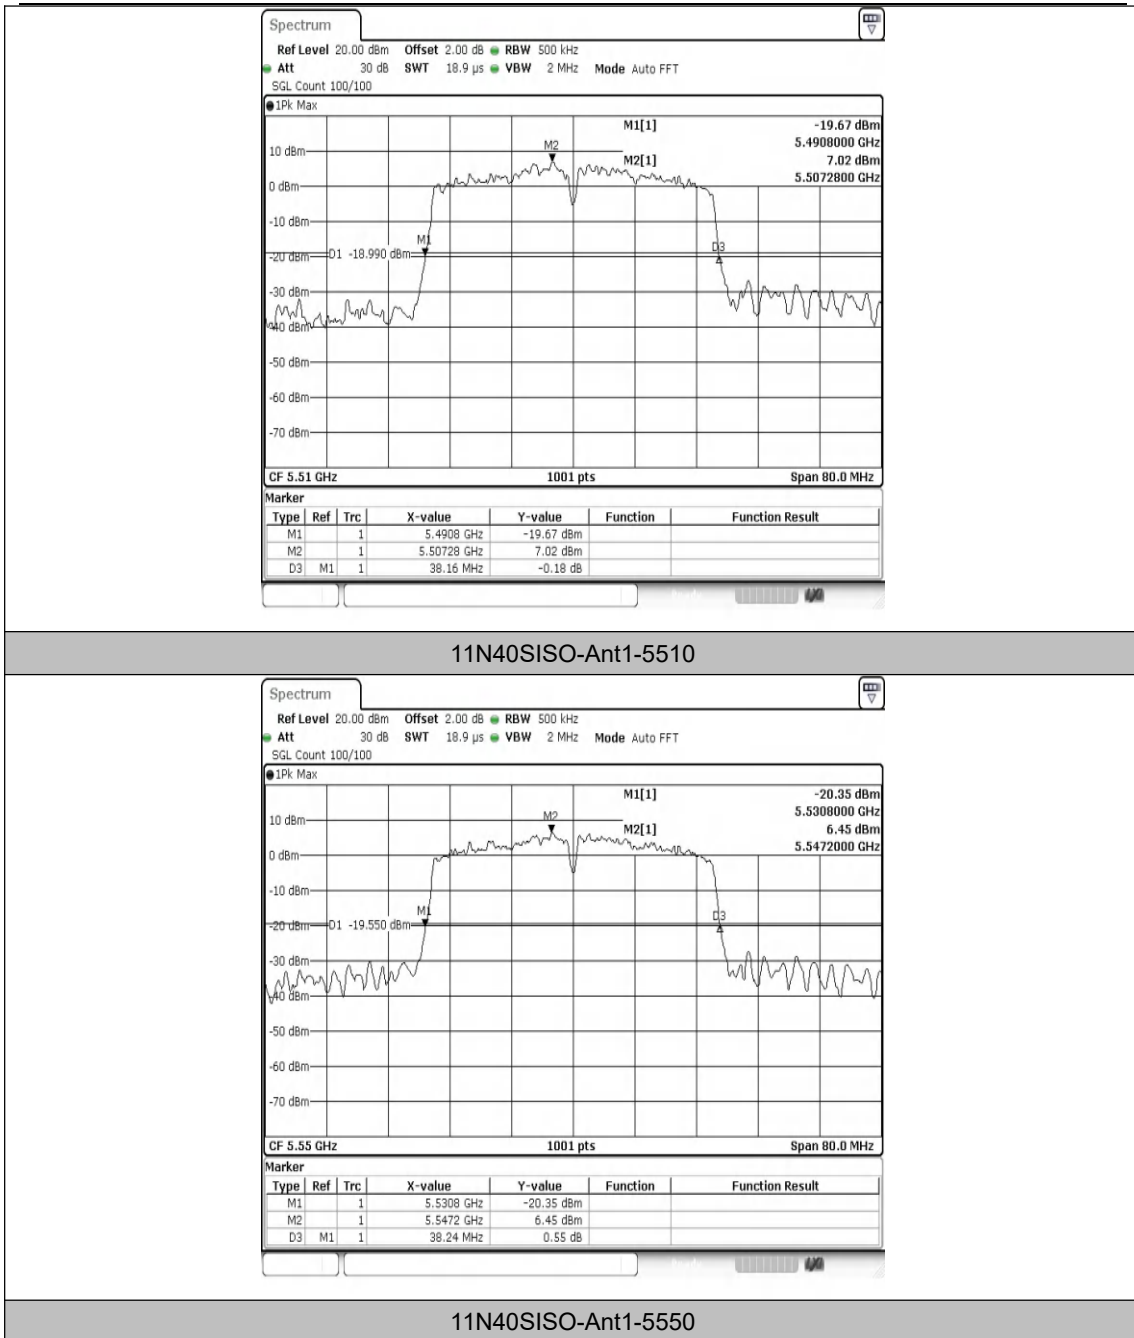



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

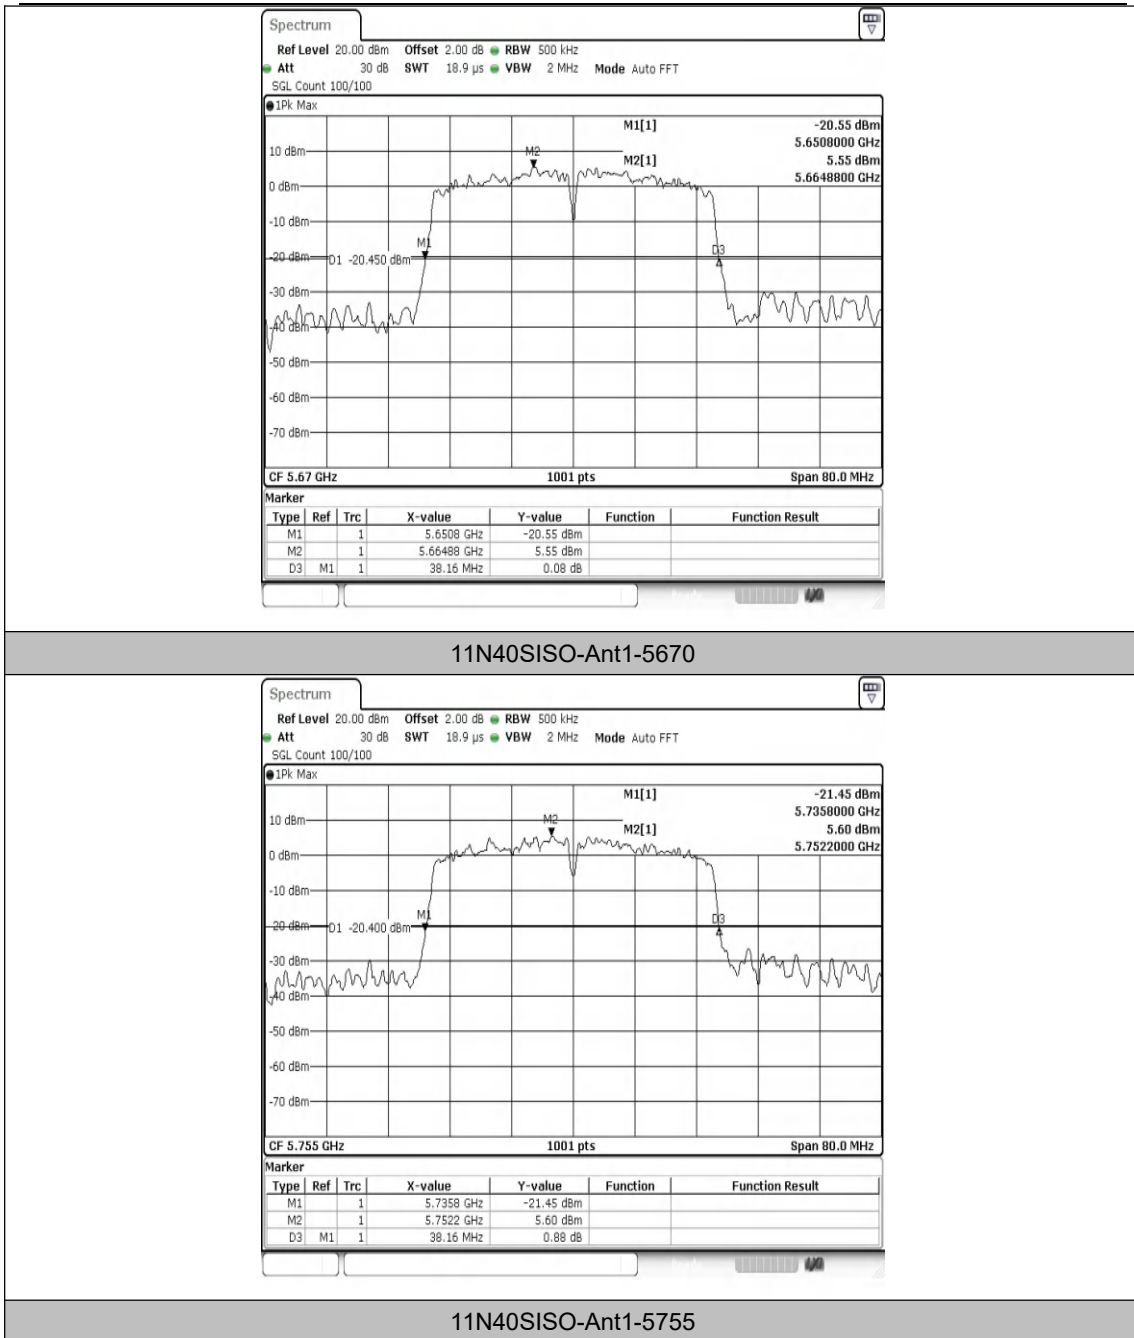


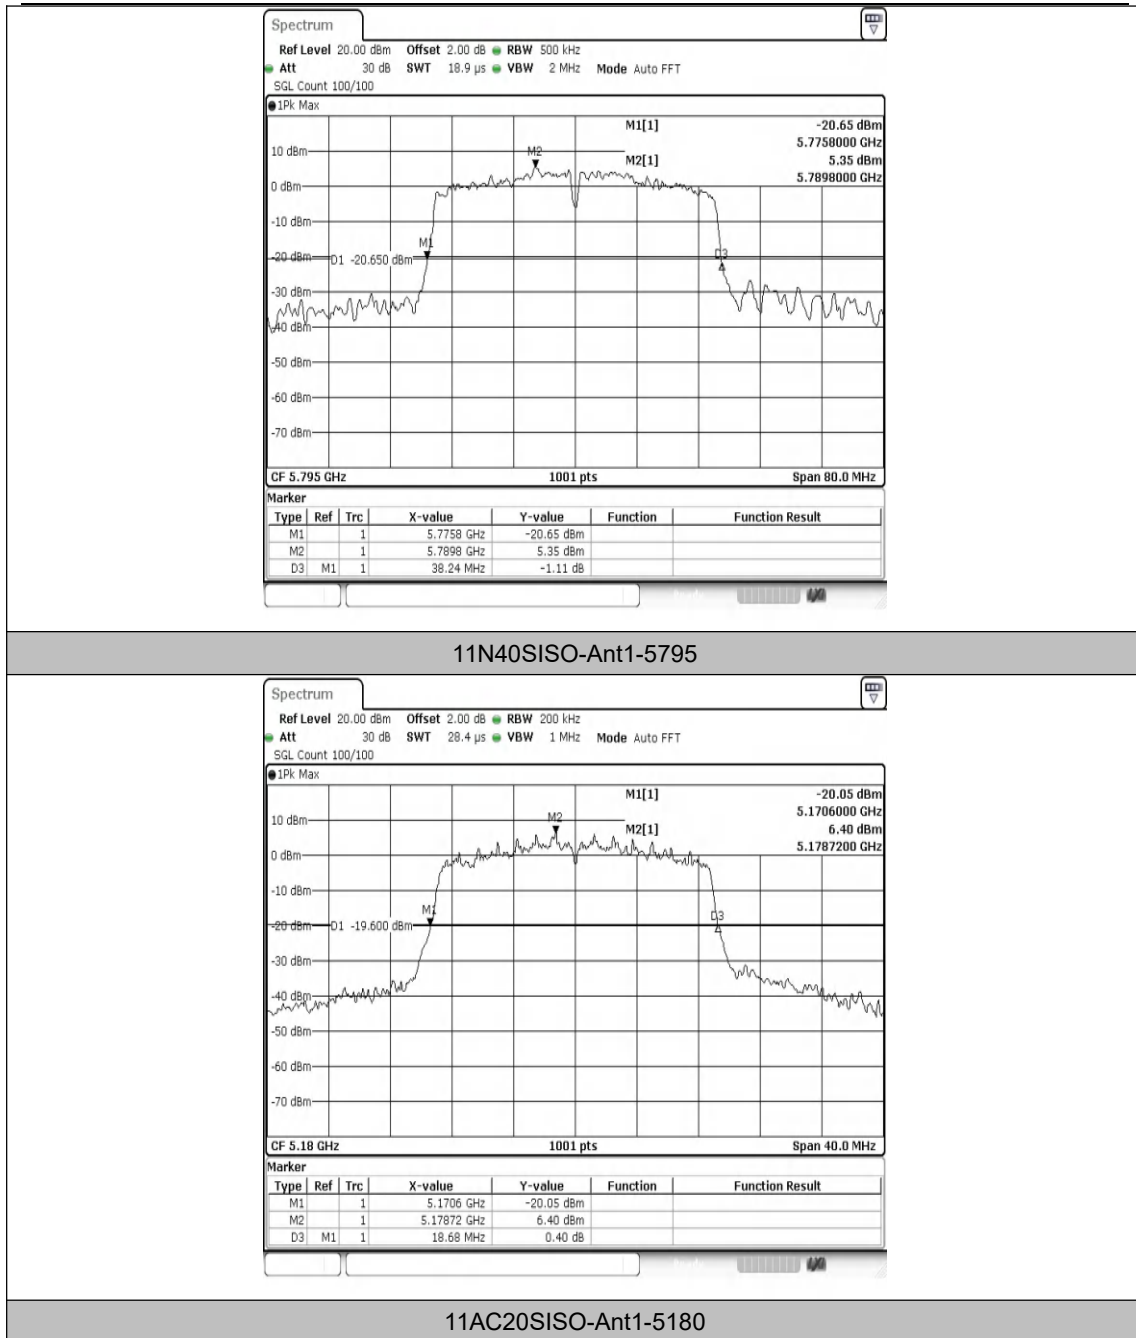


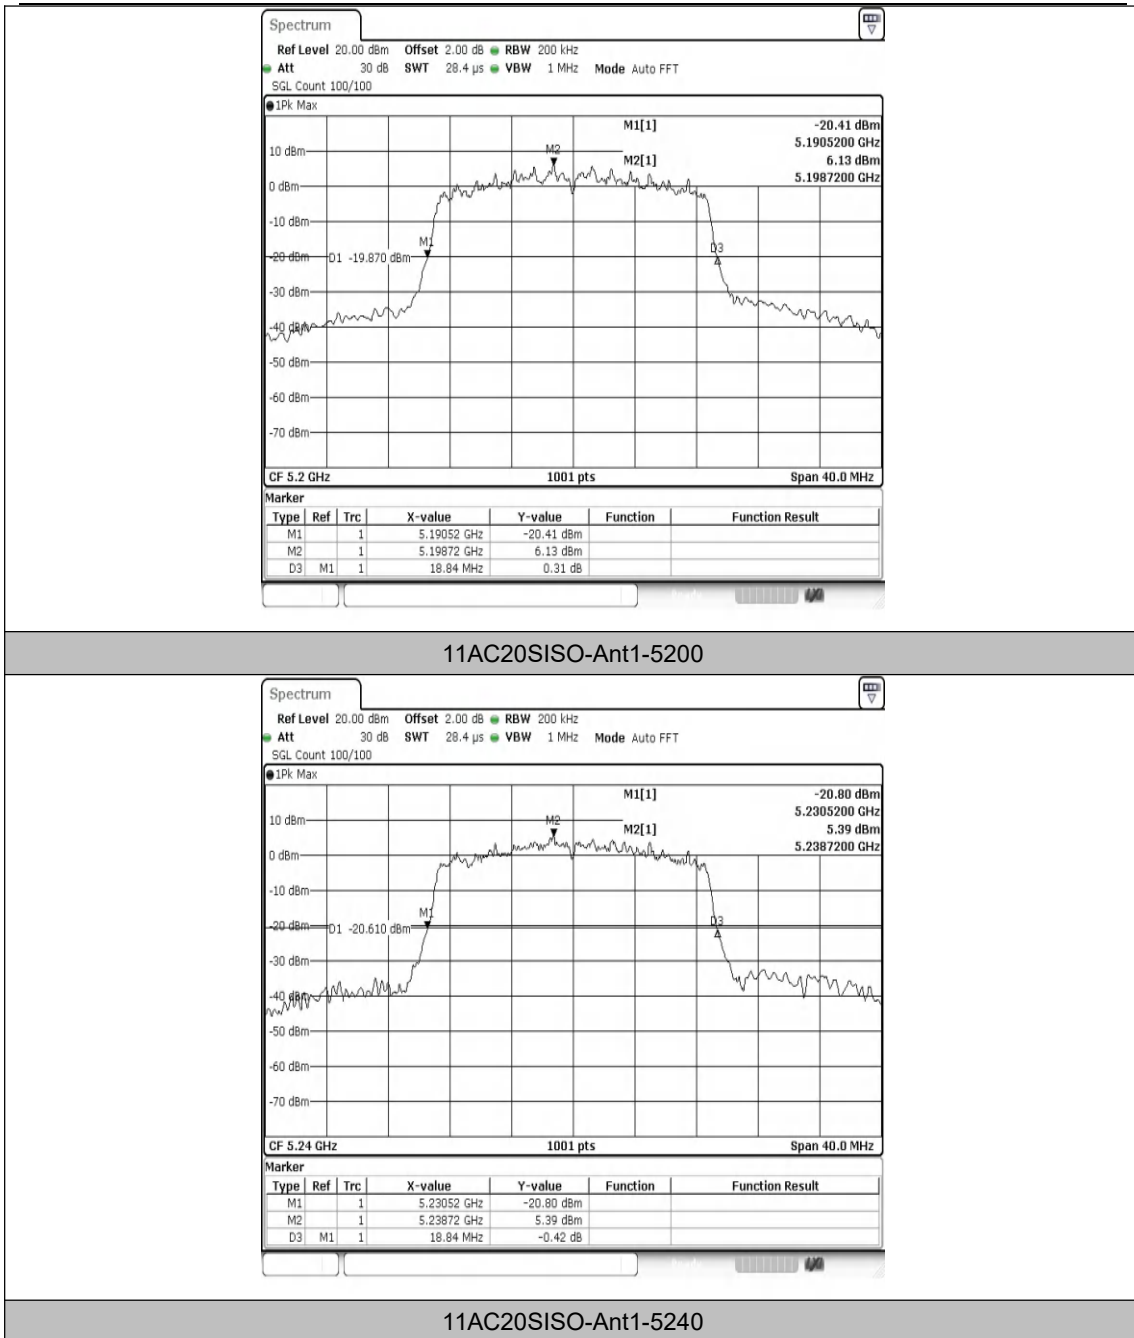


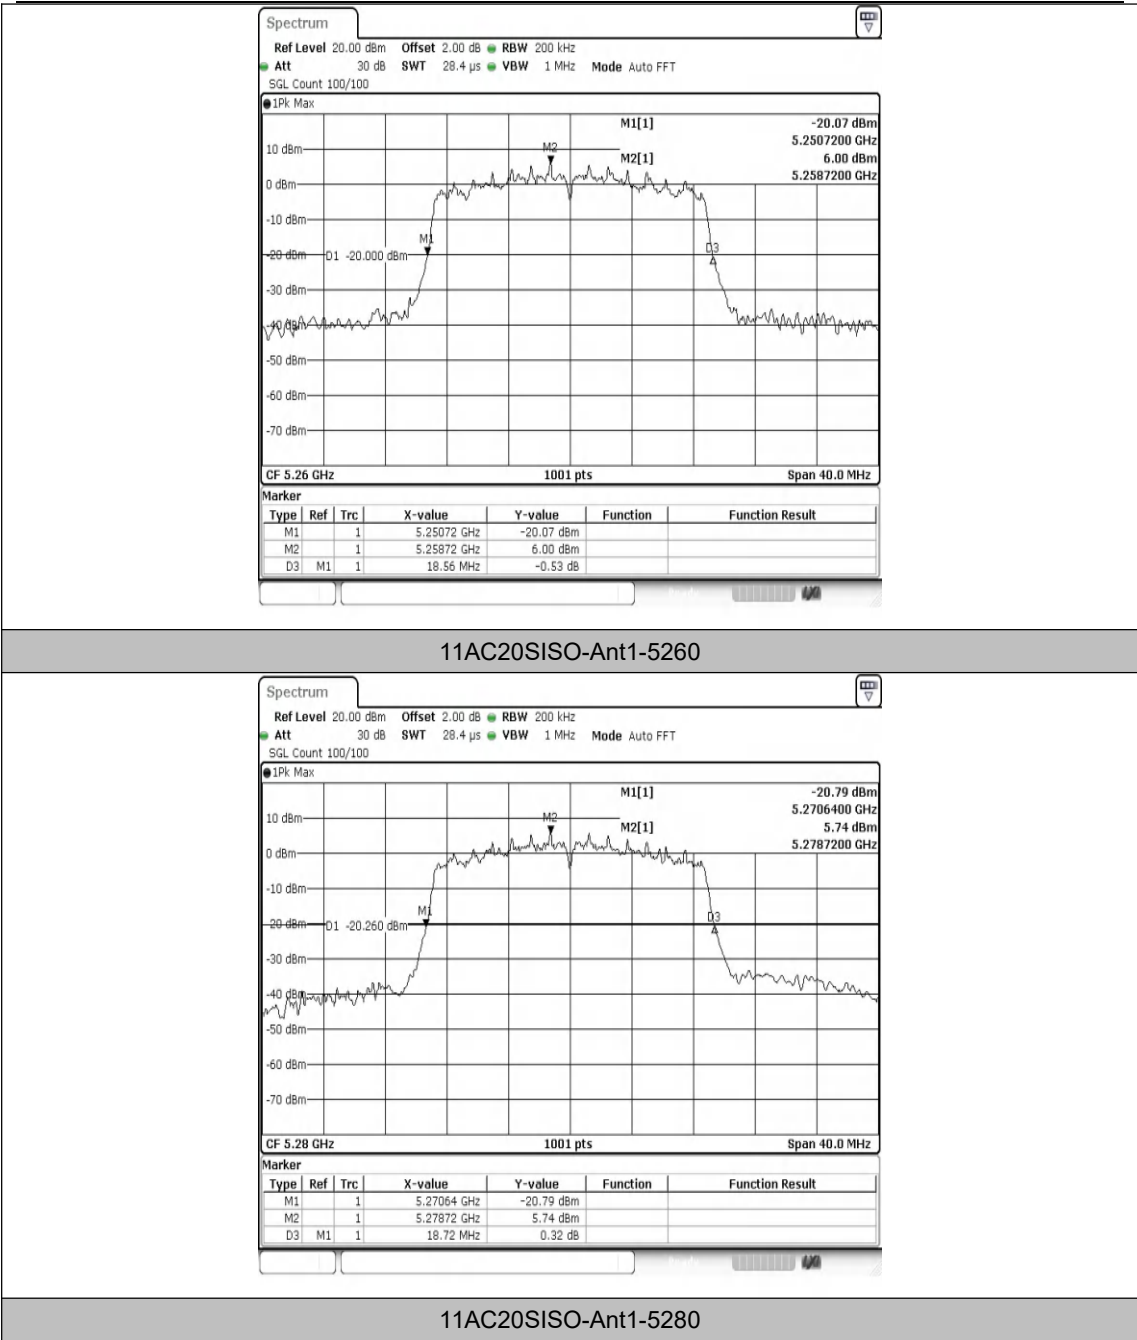





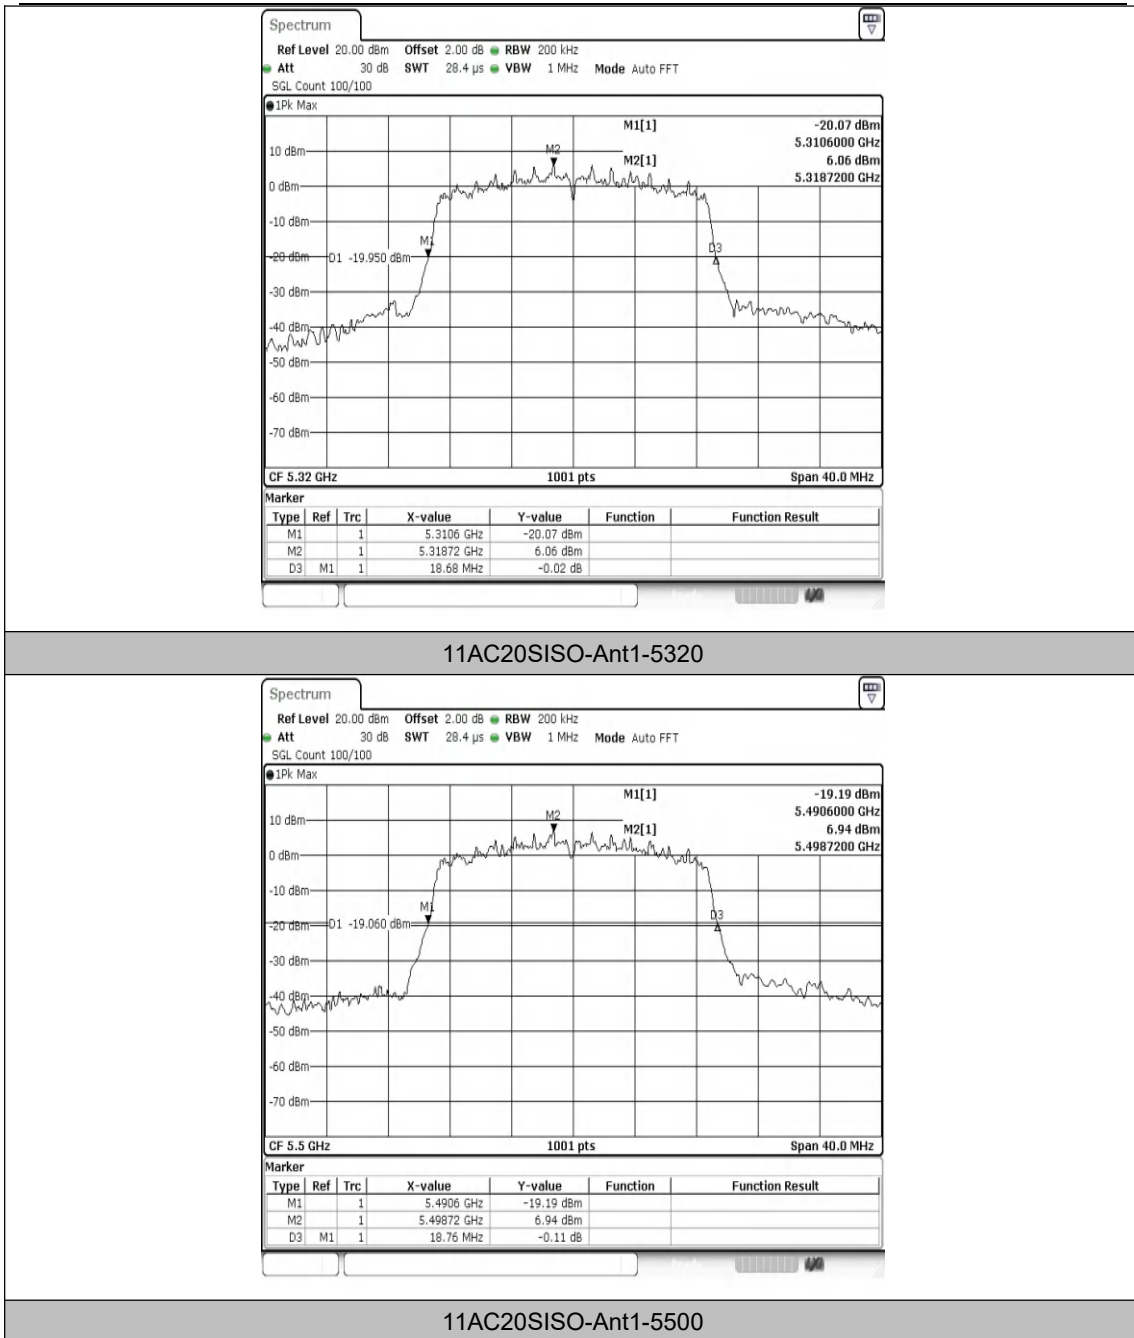


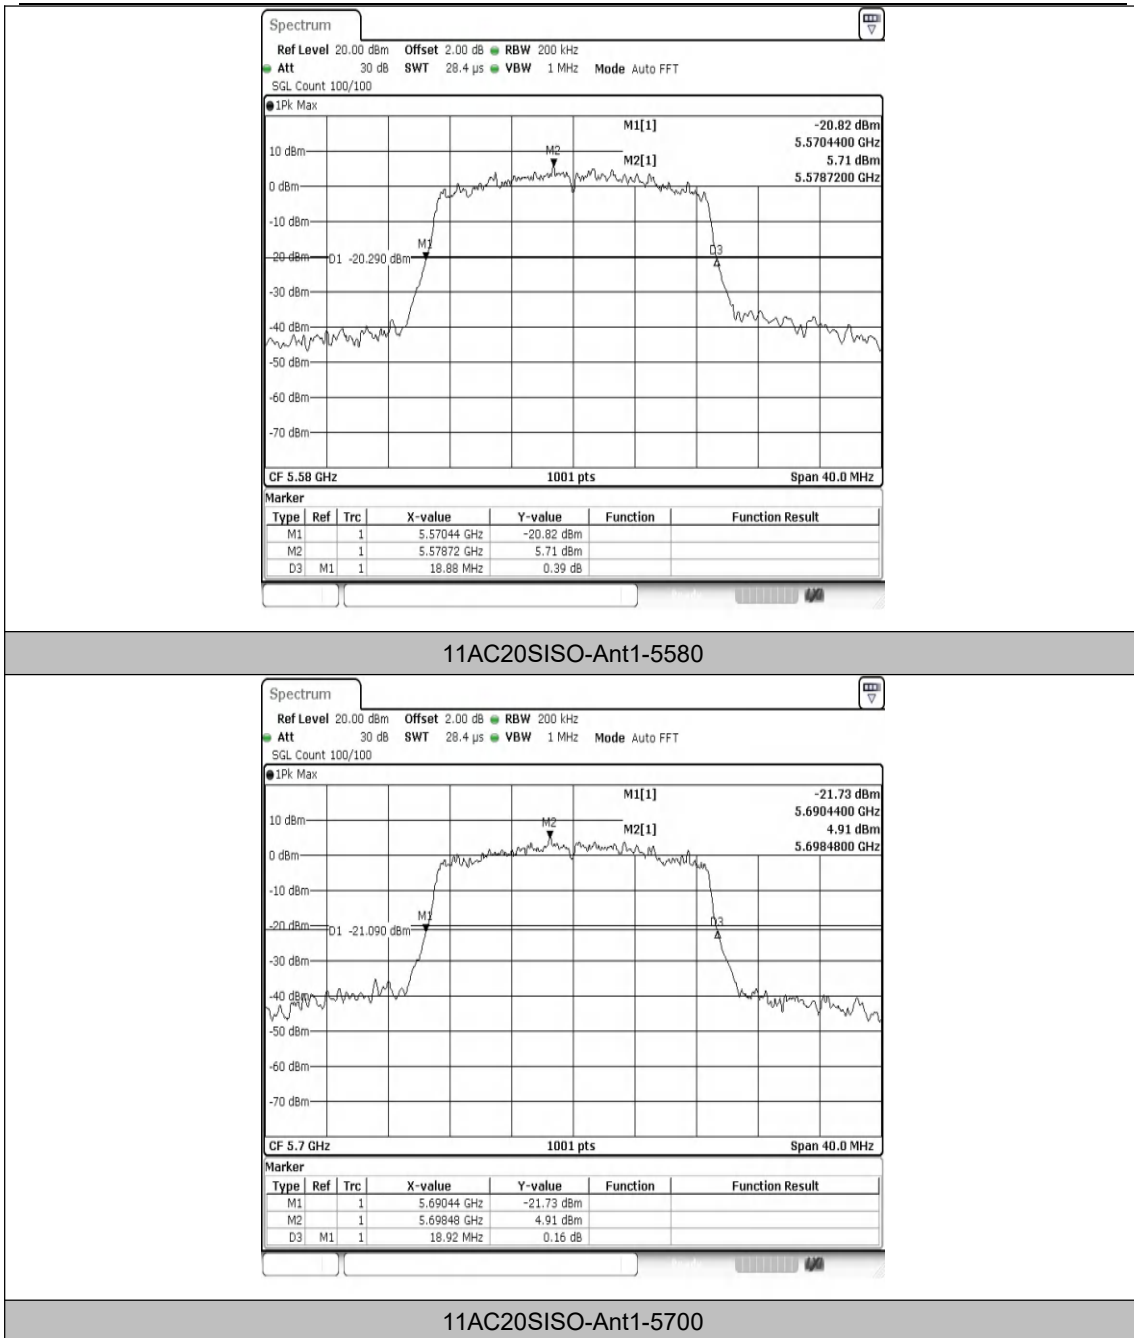

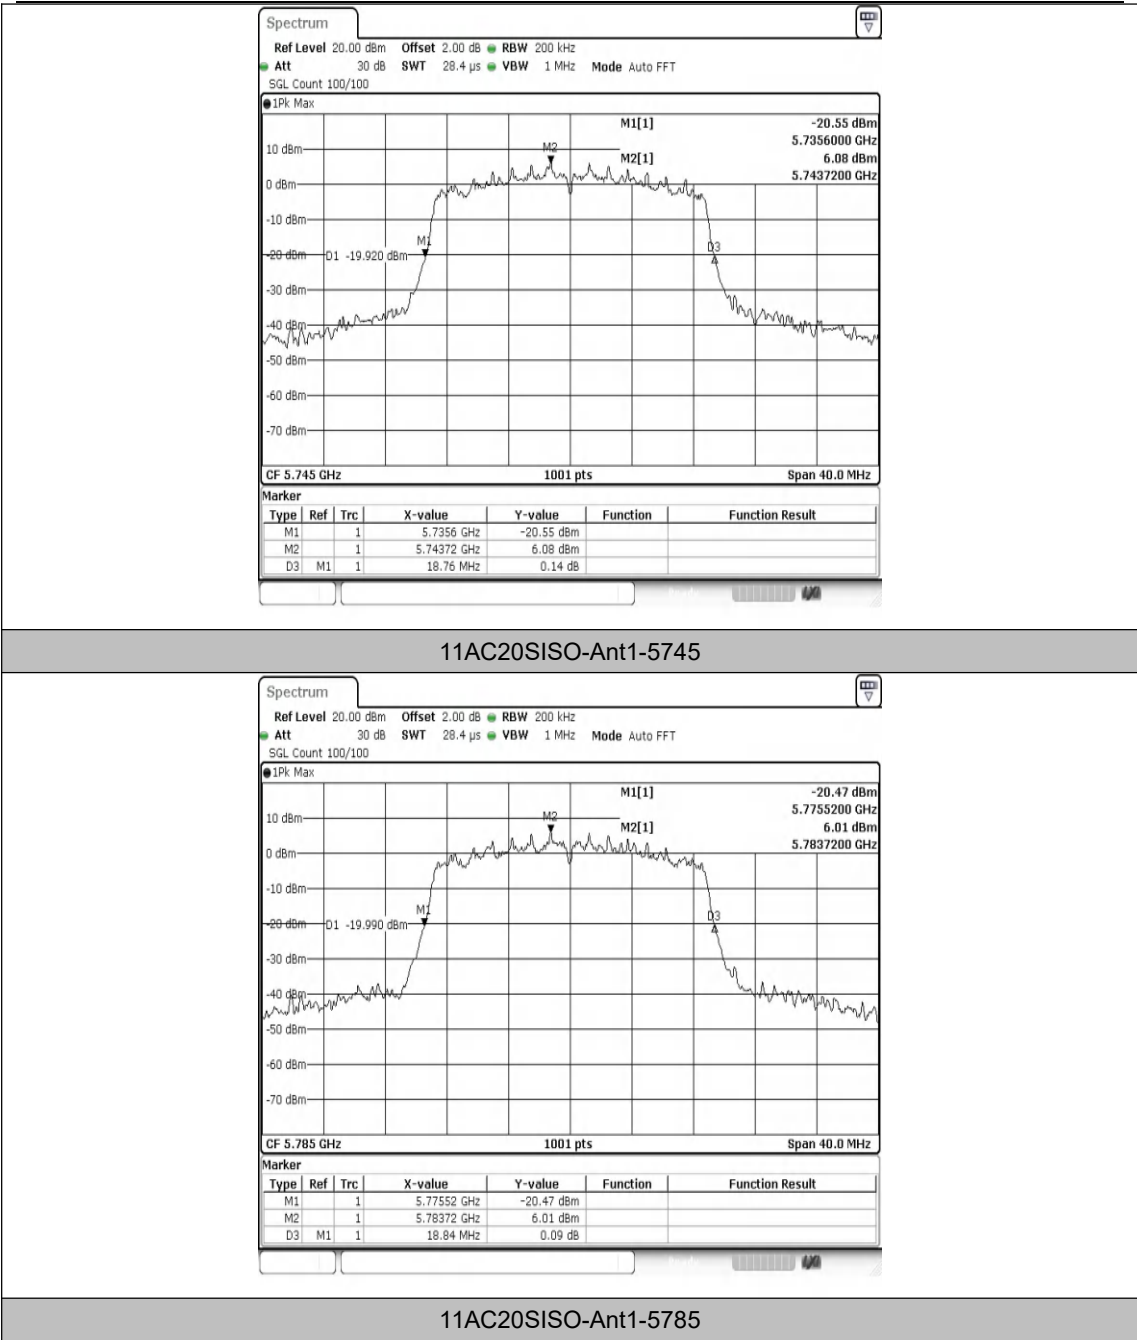

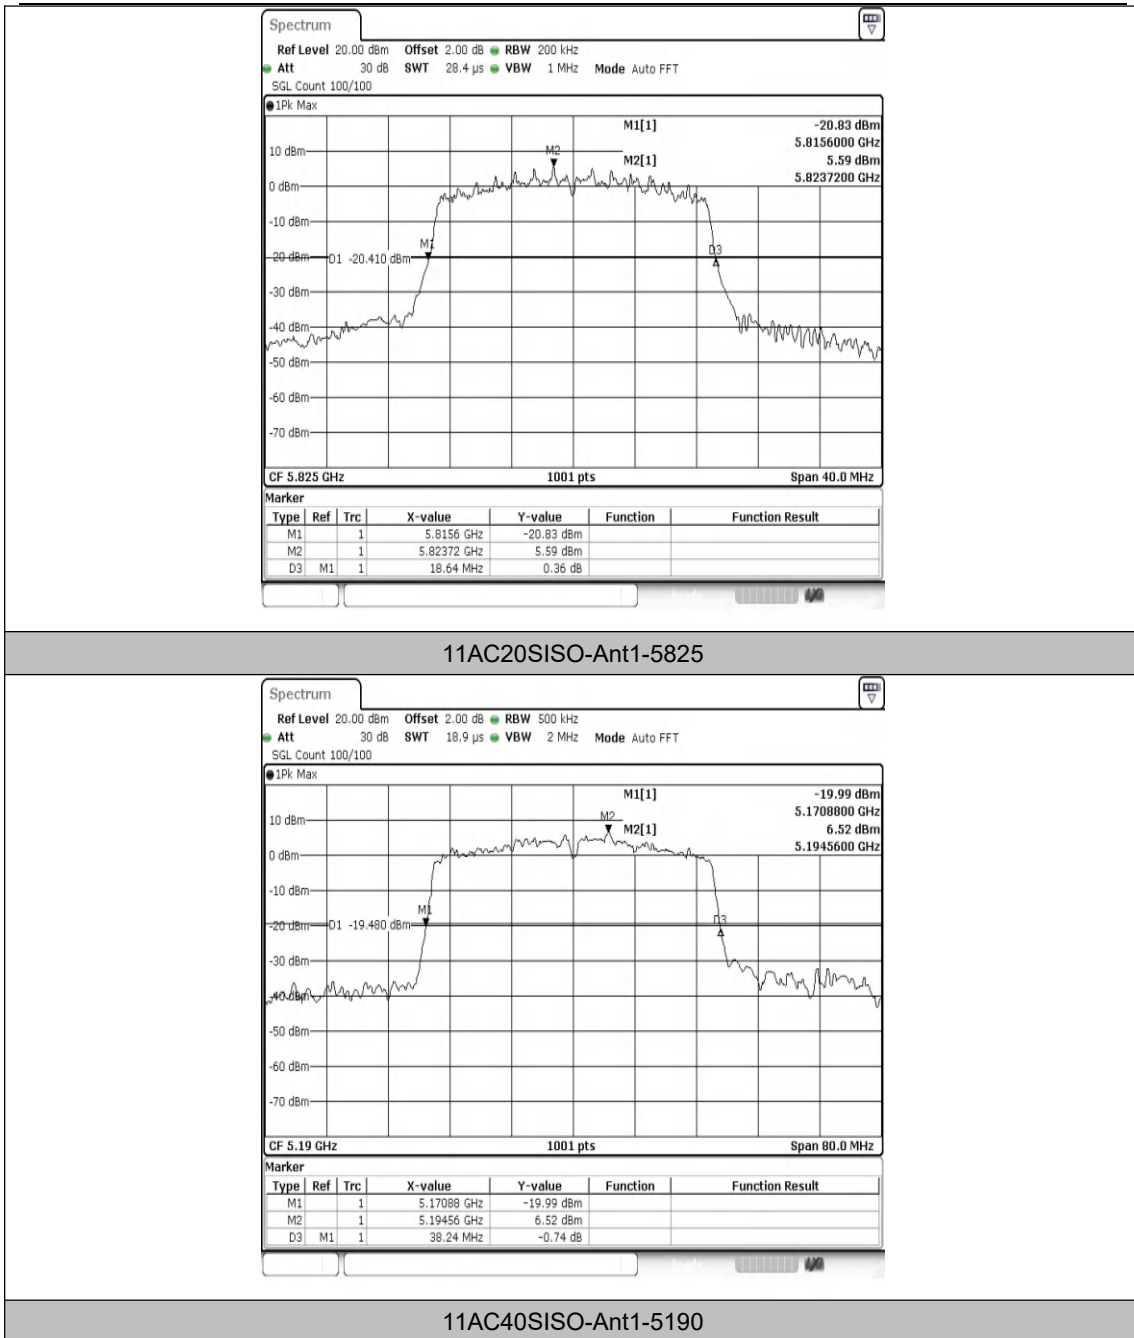

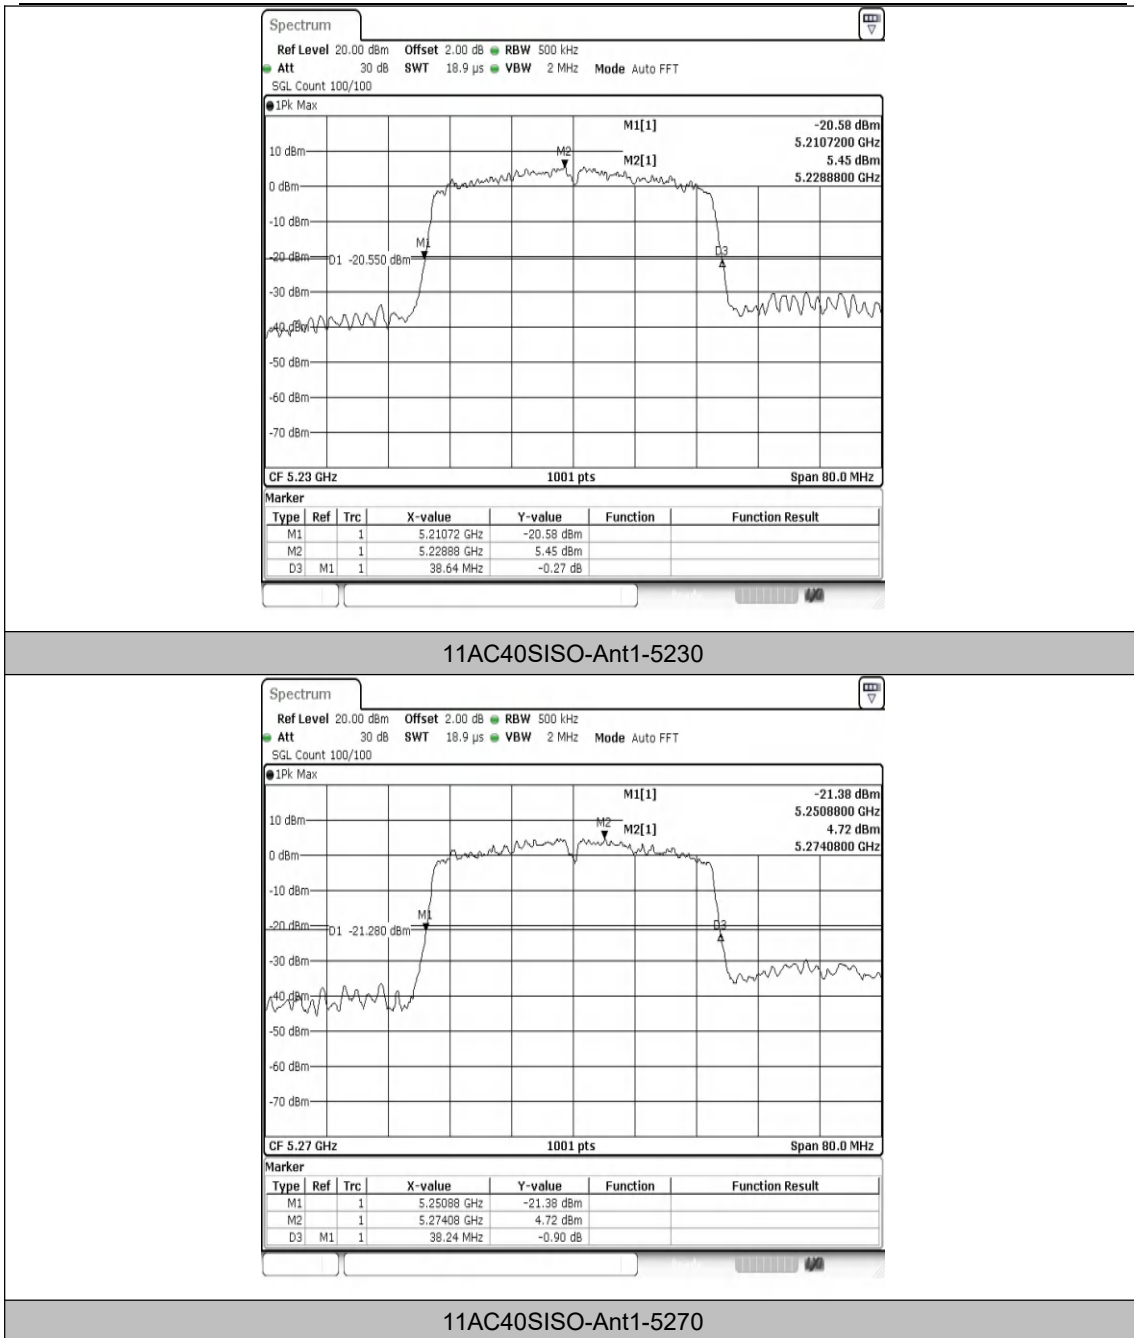


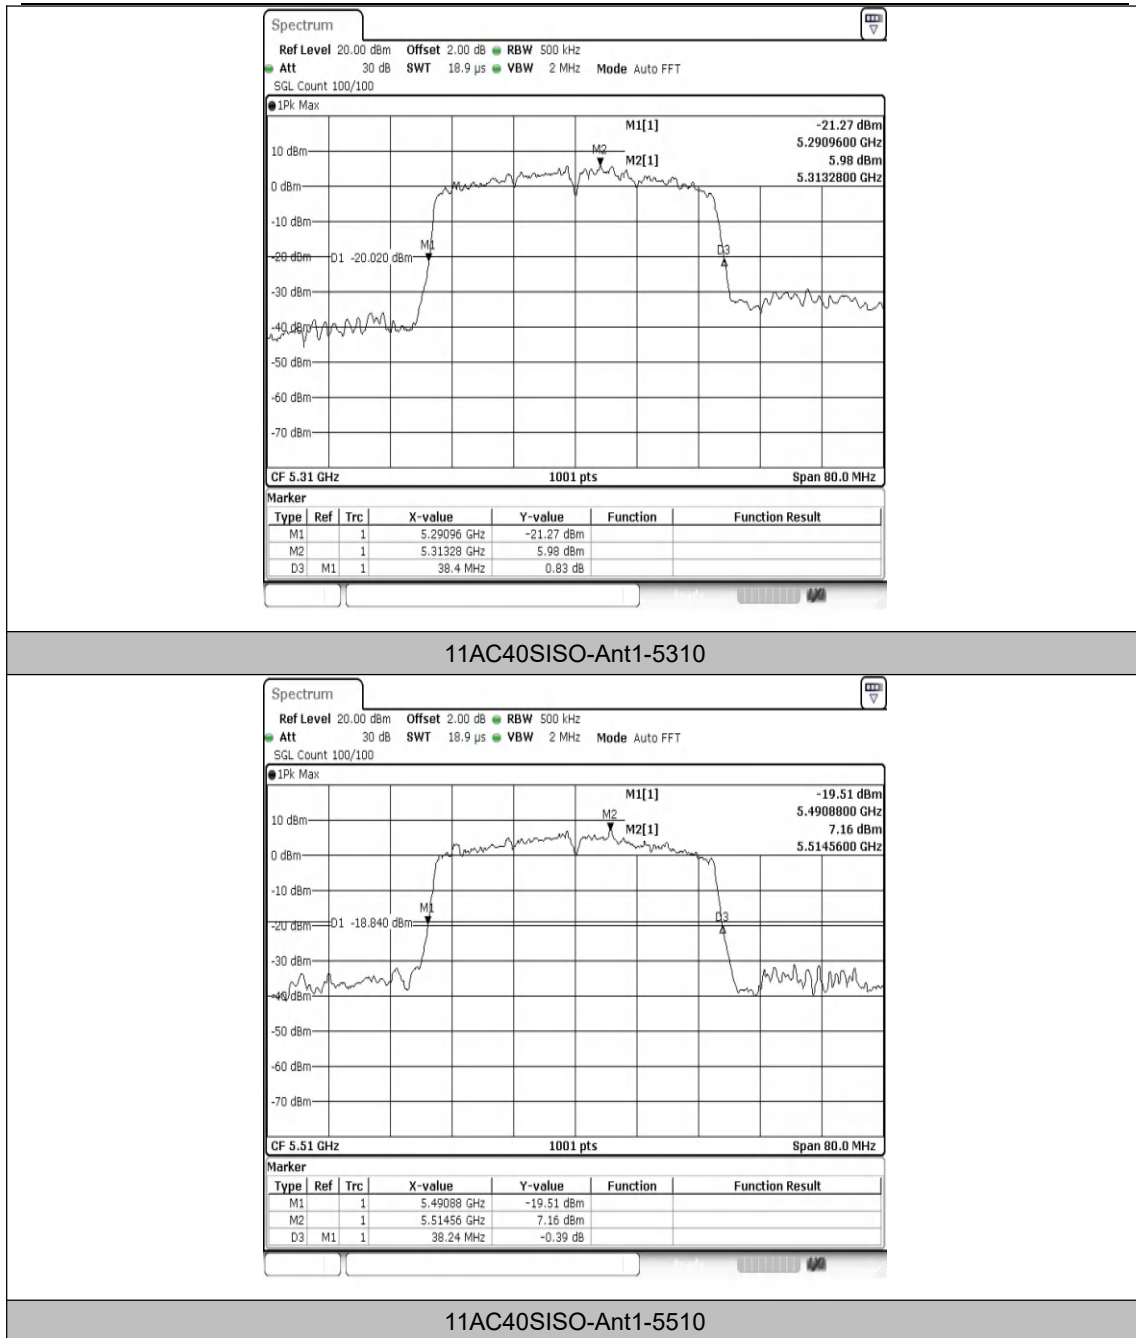


**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

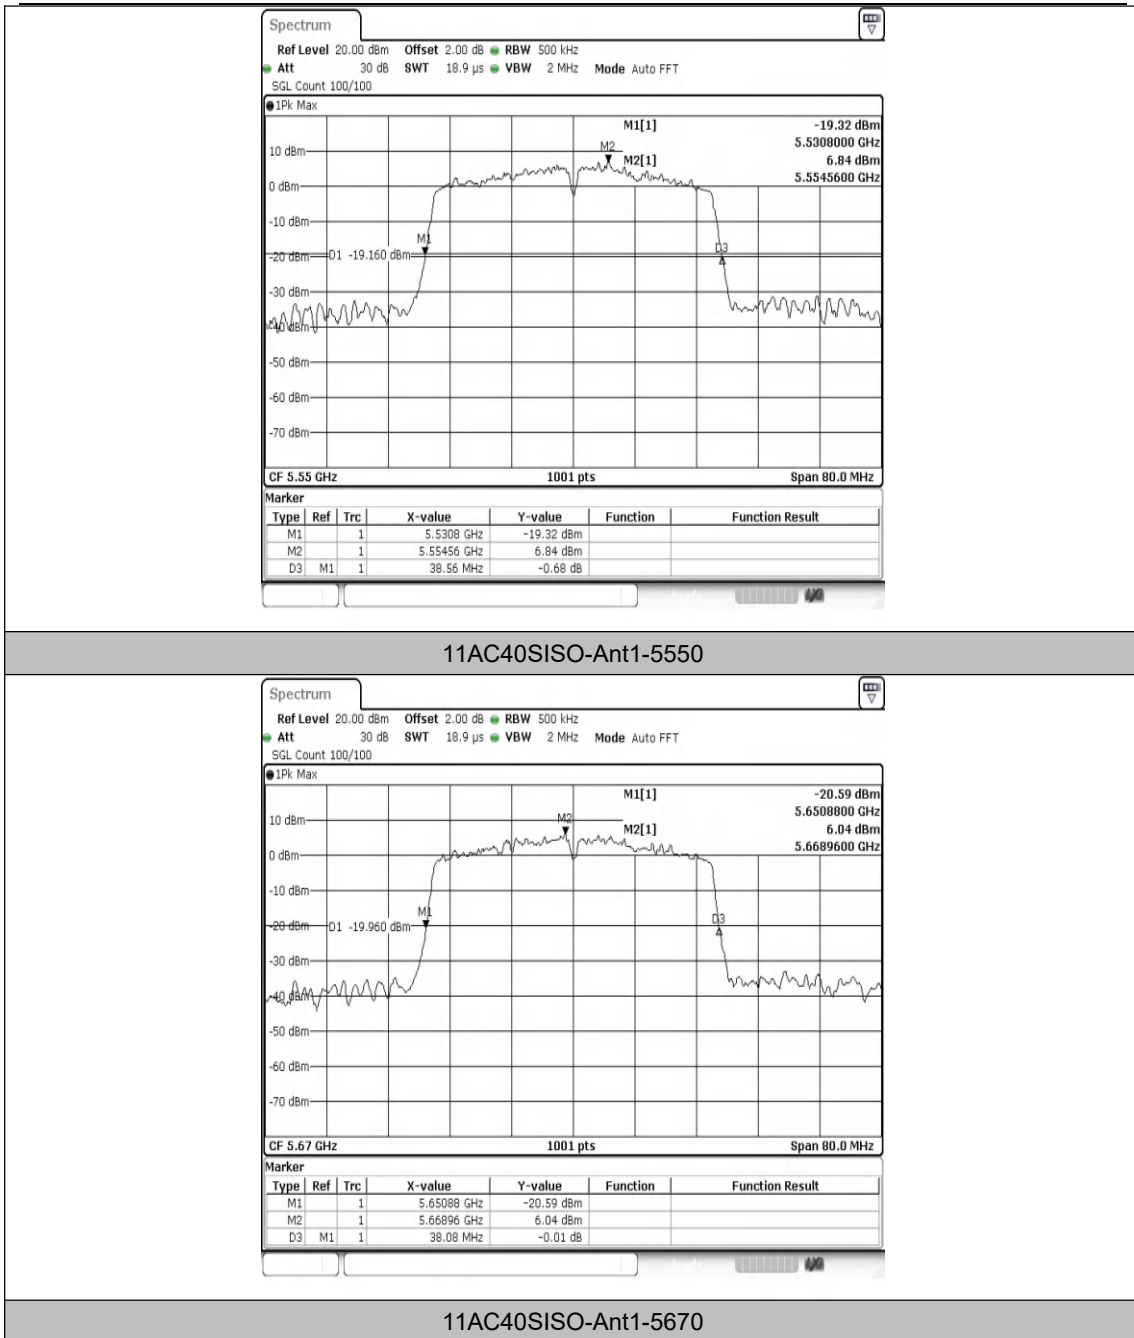



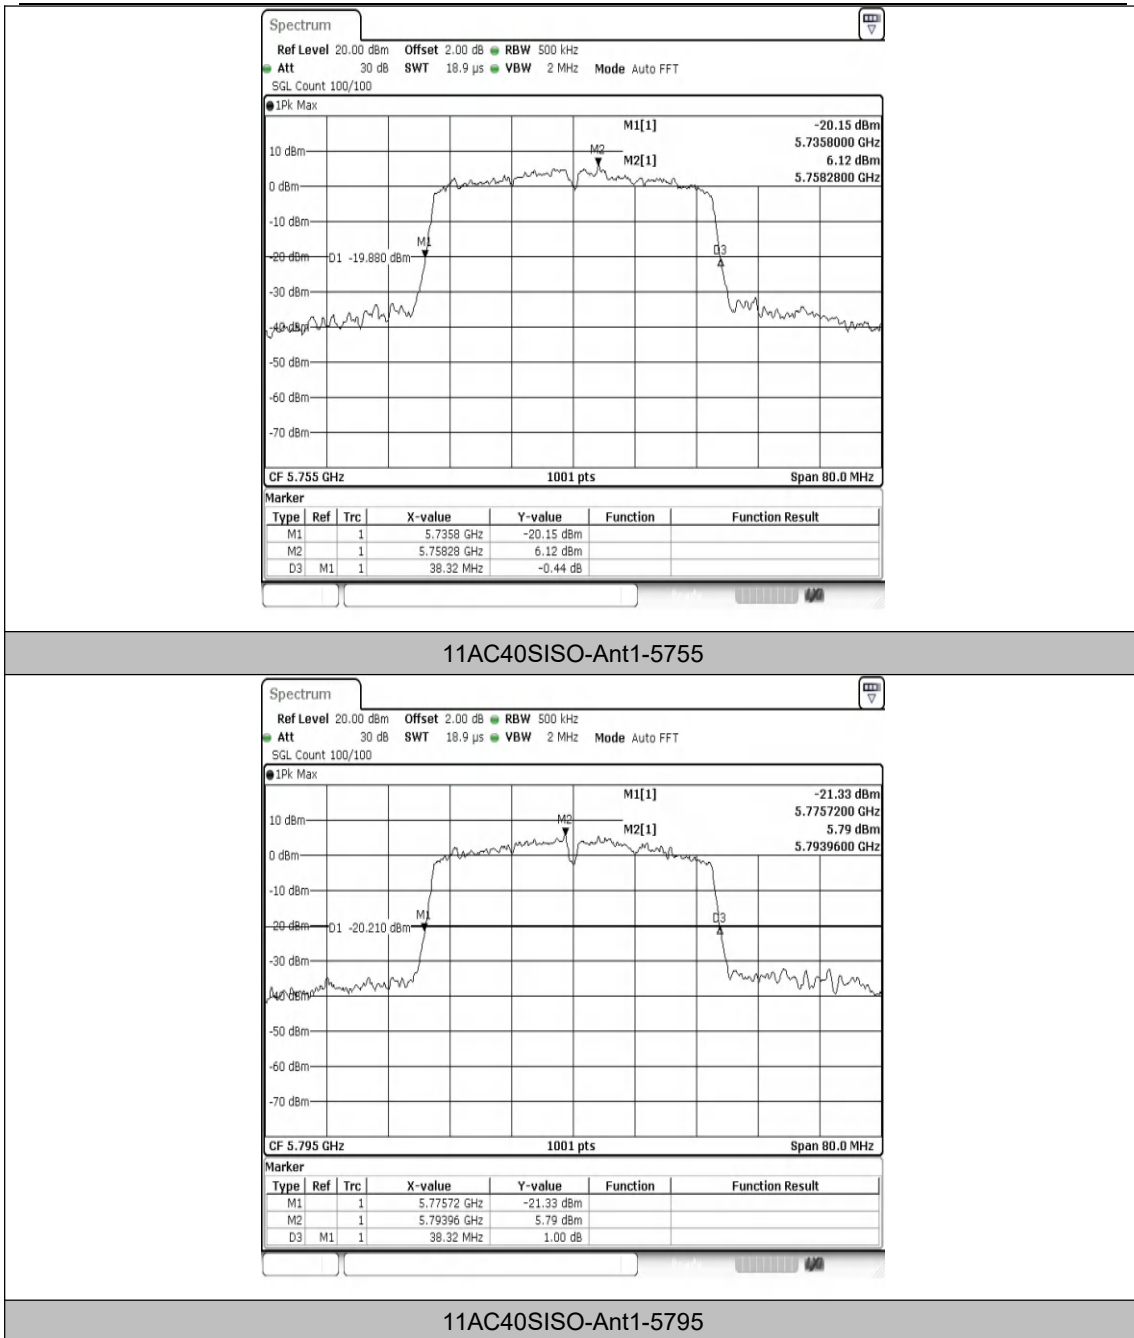


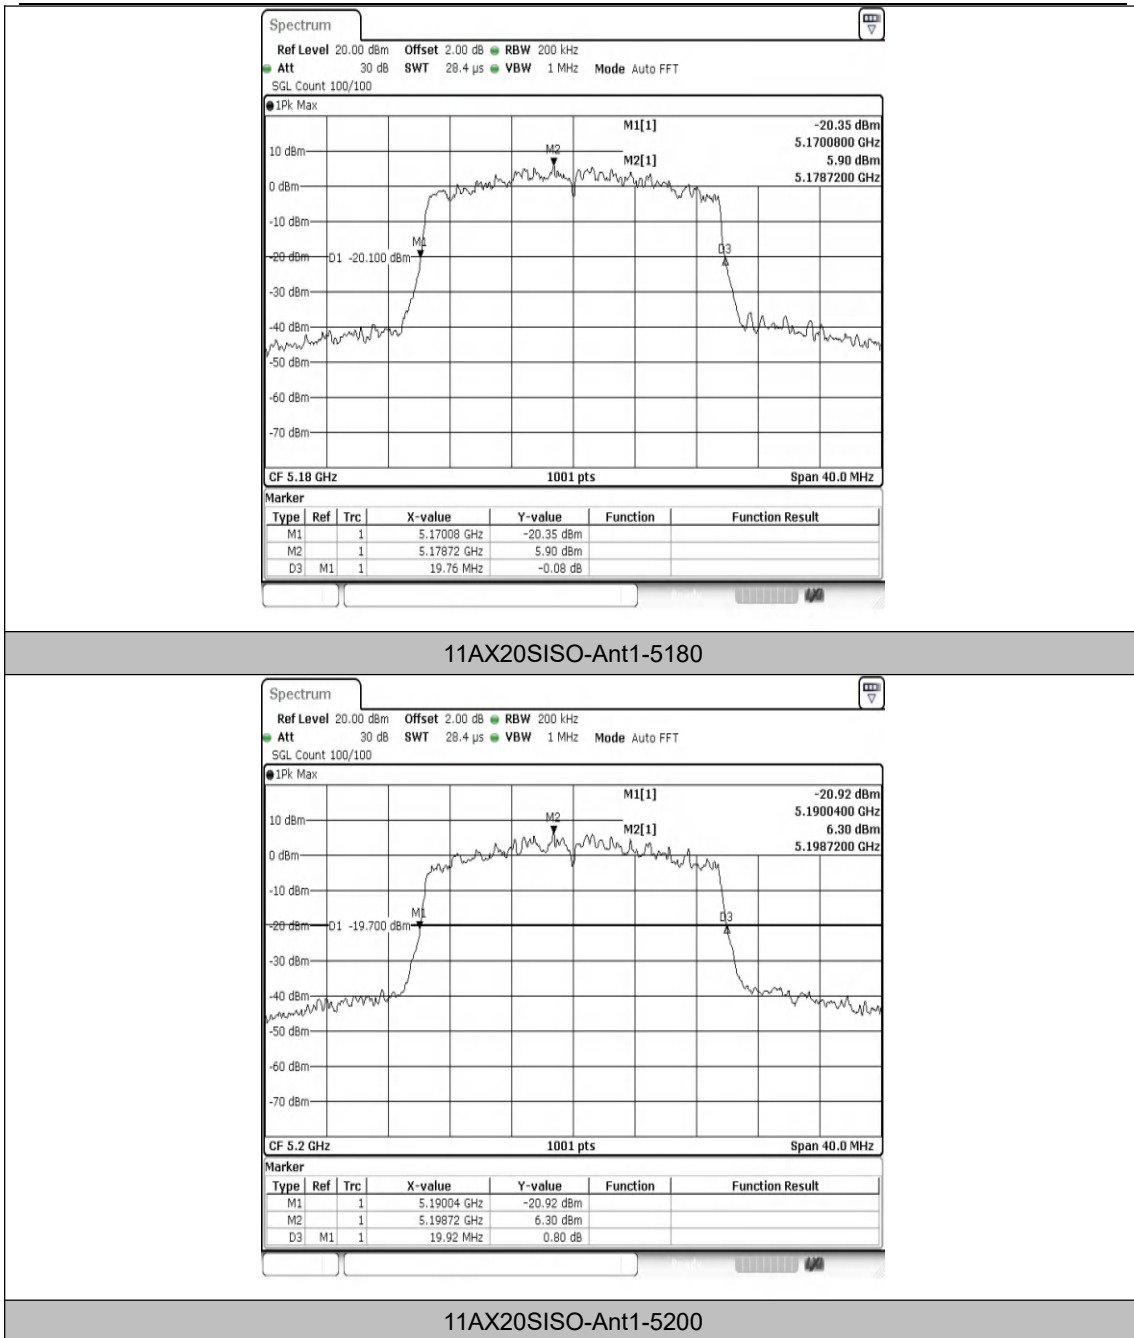



#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

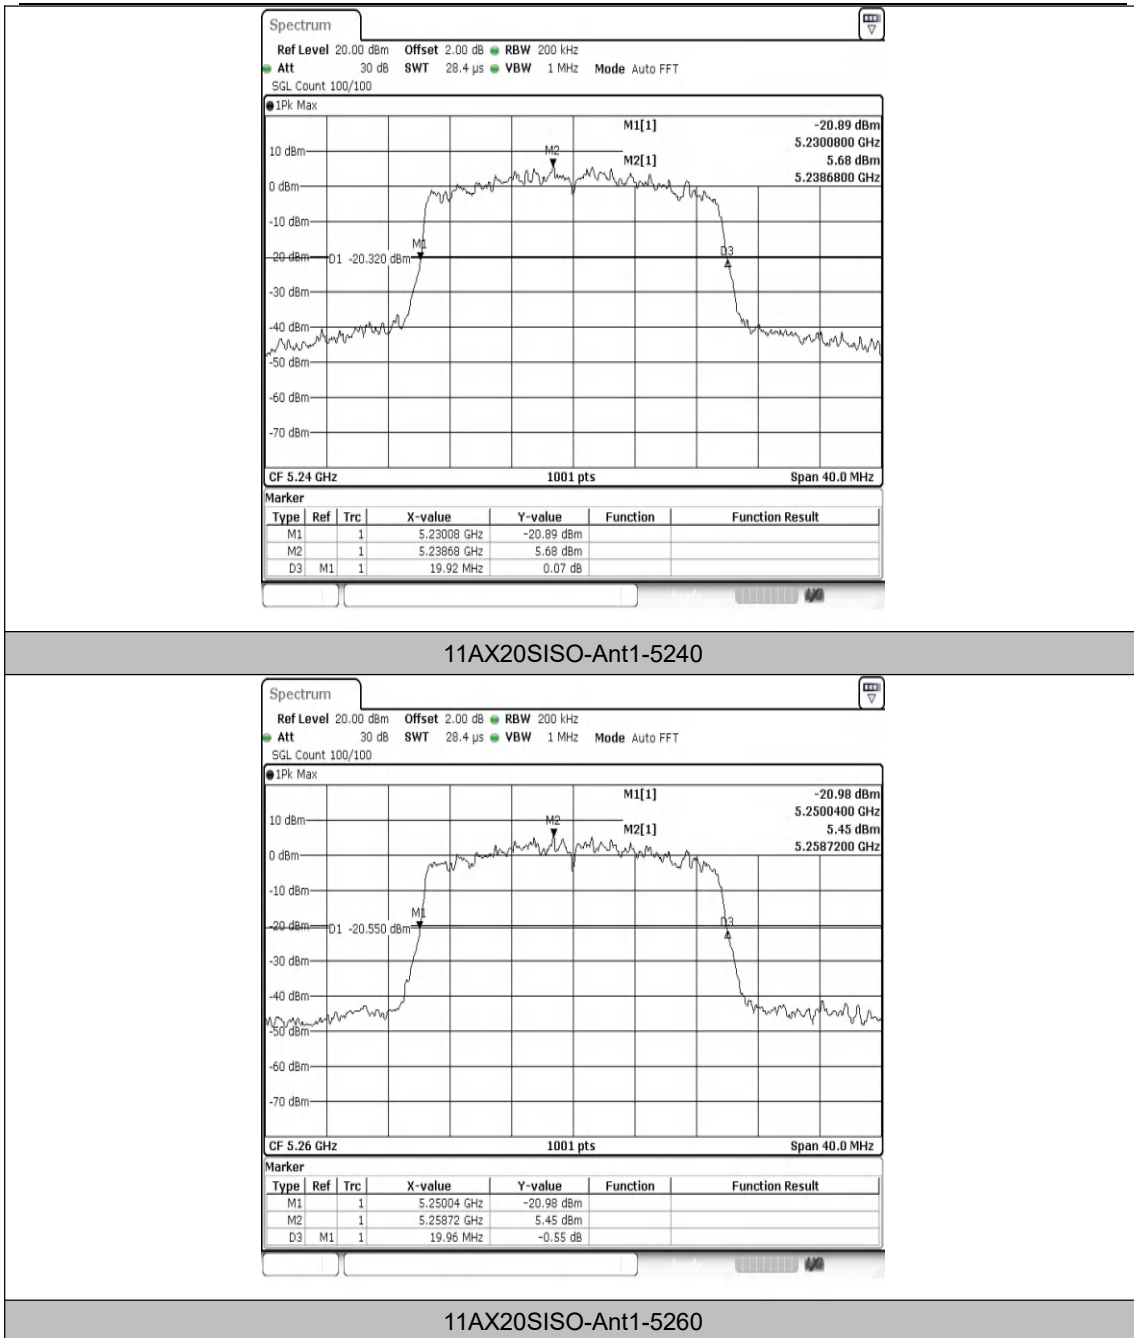

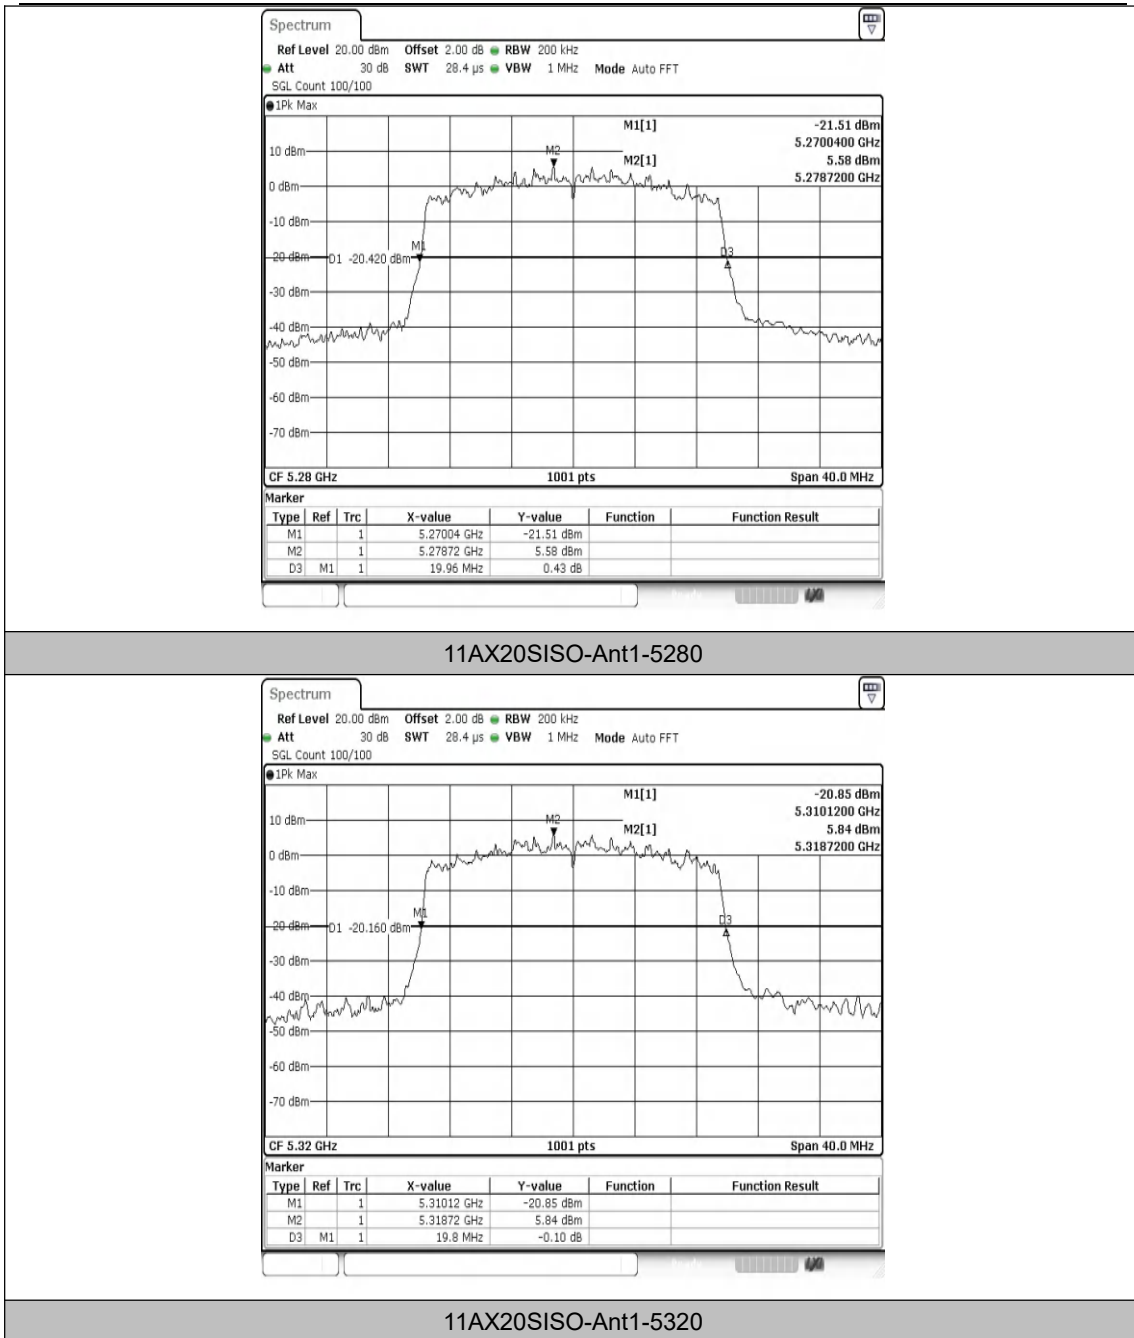


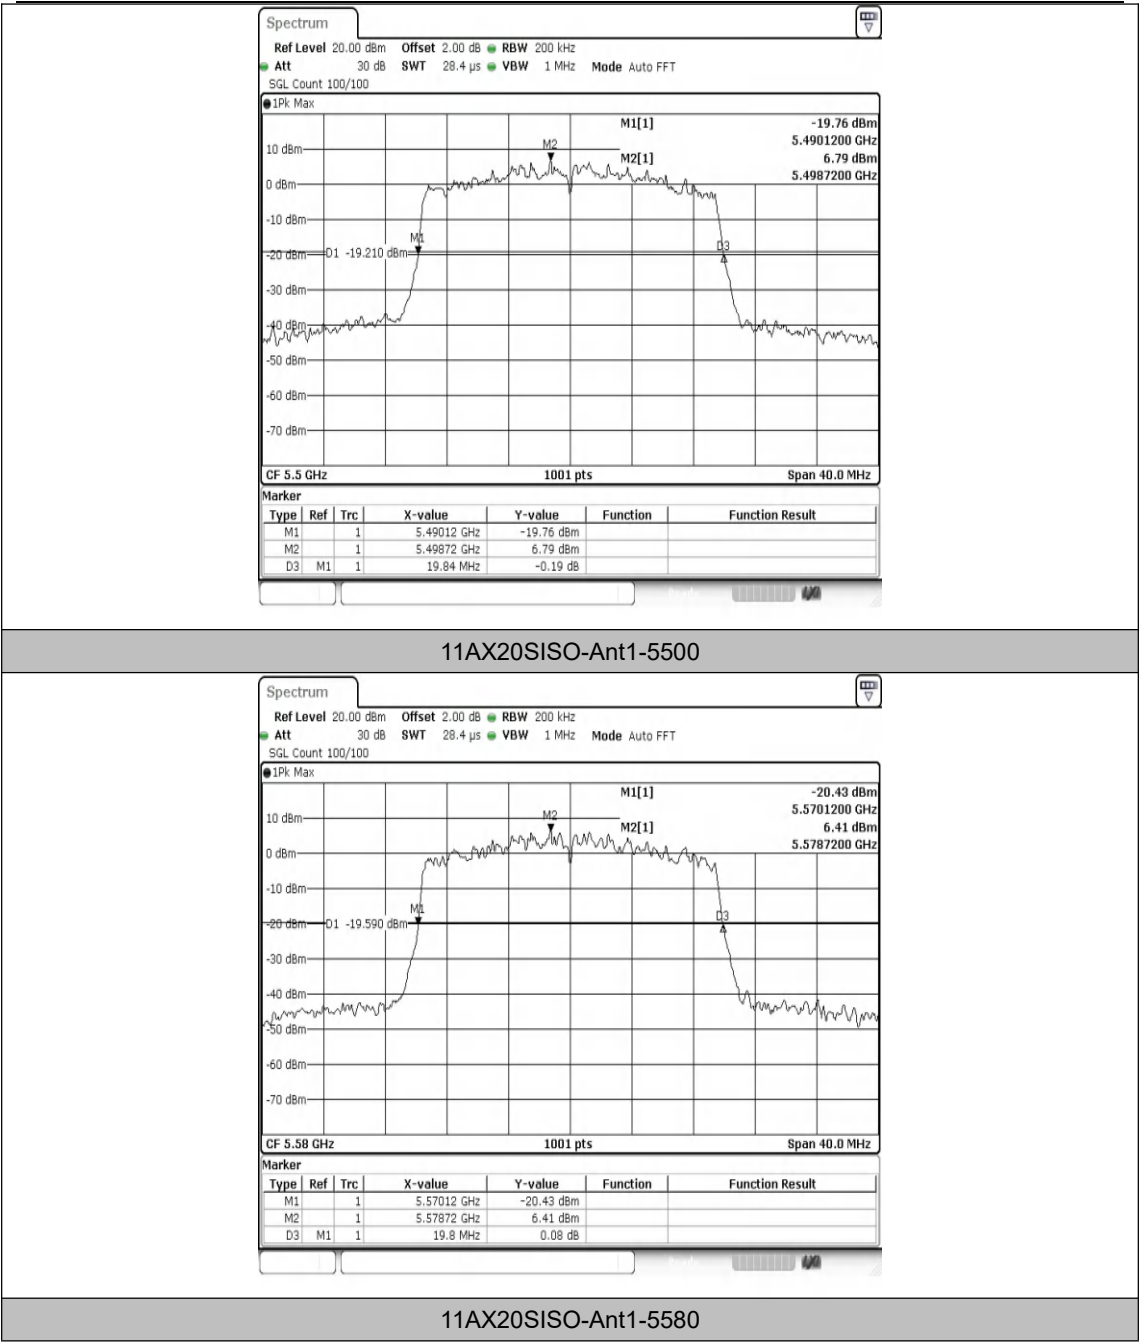


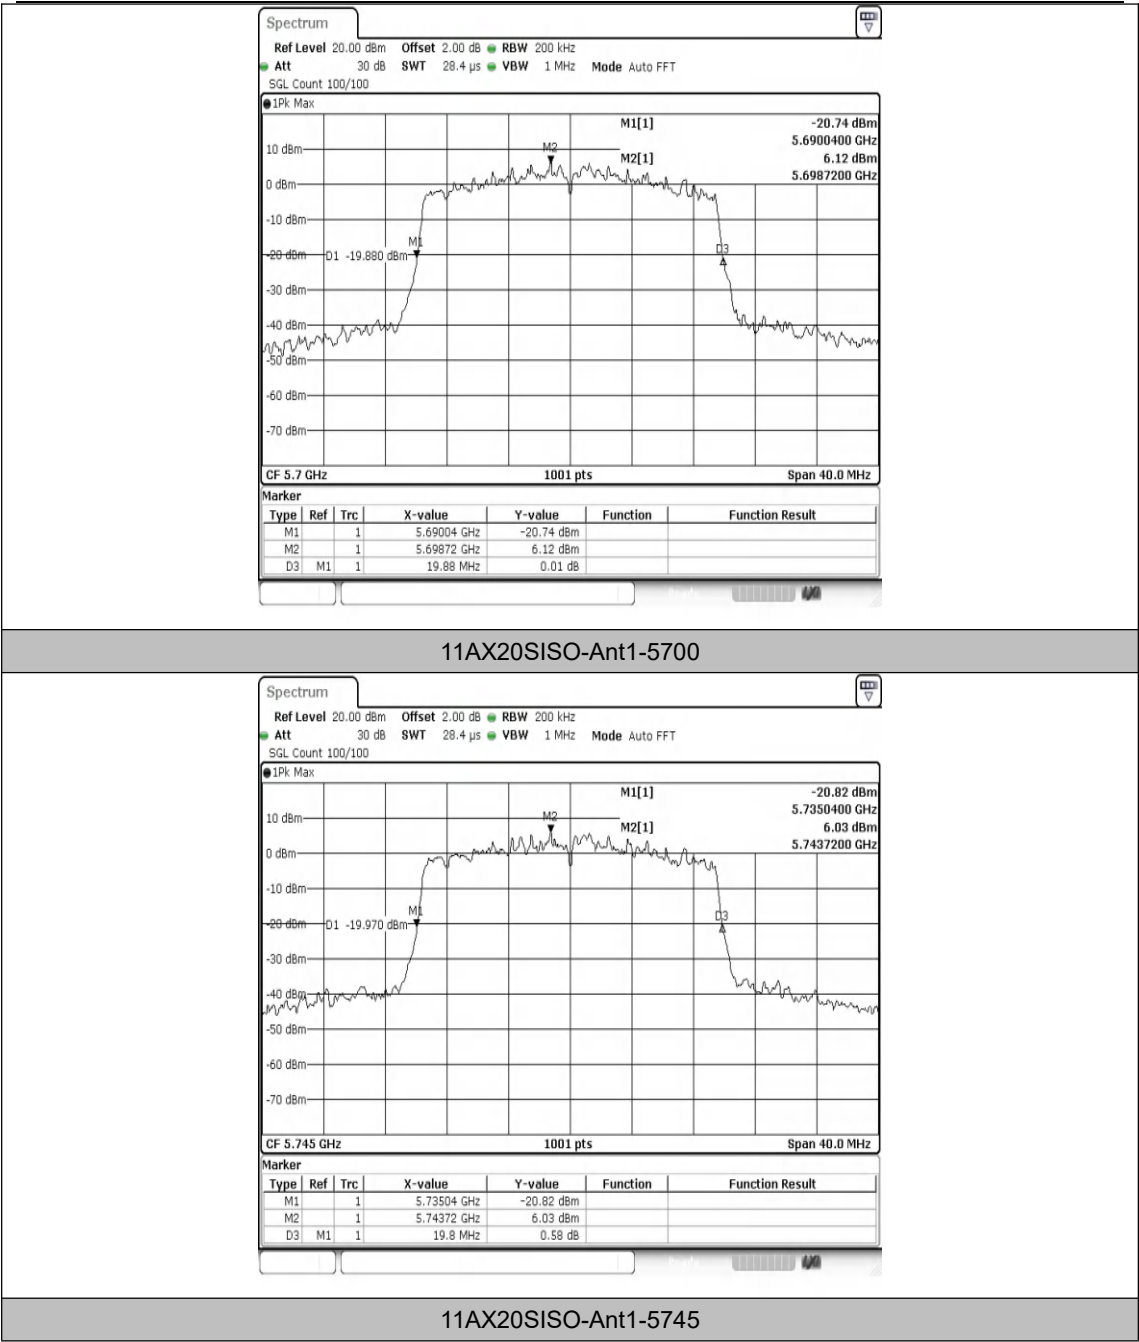


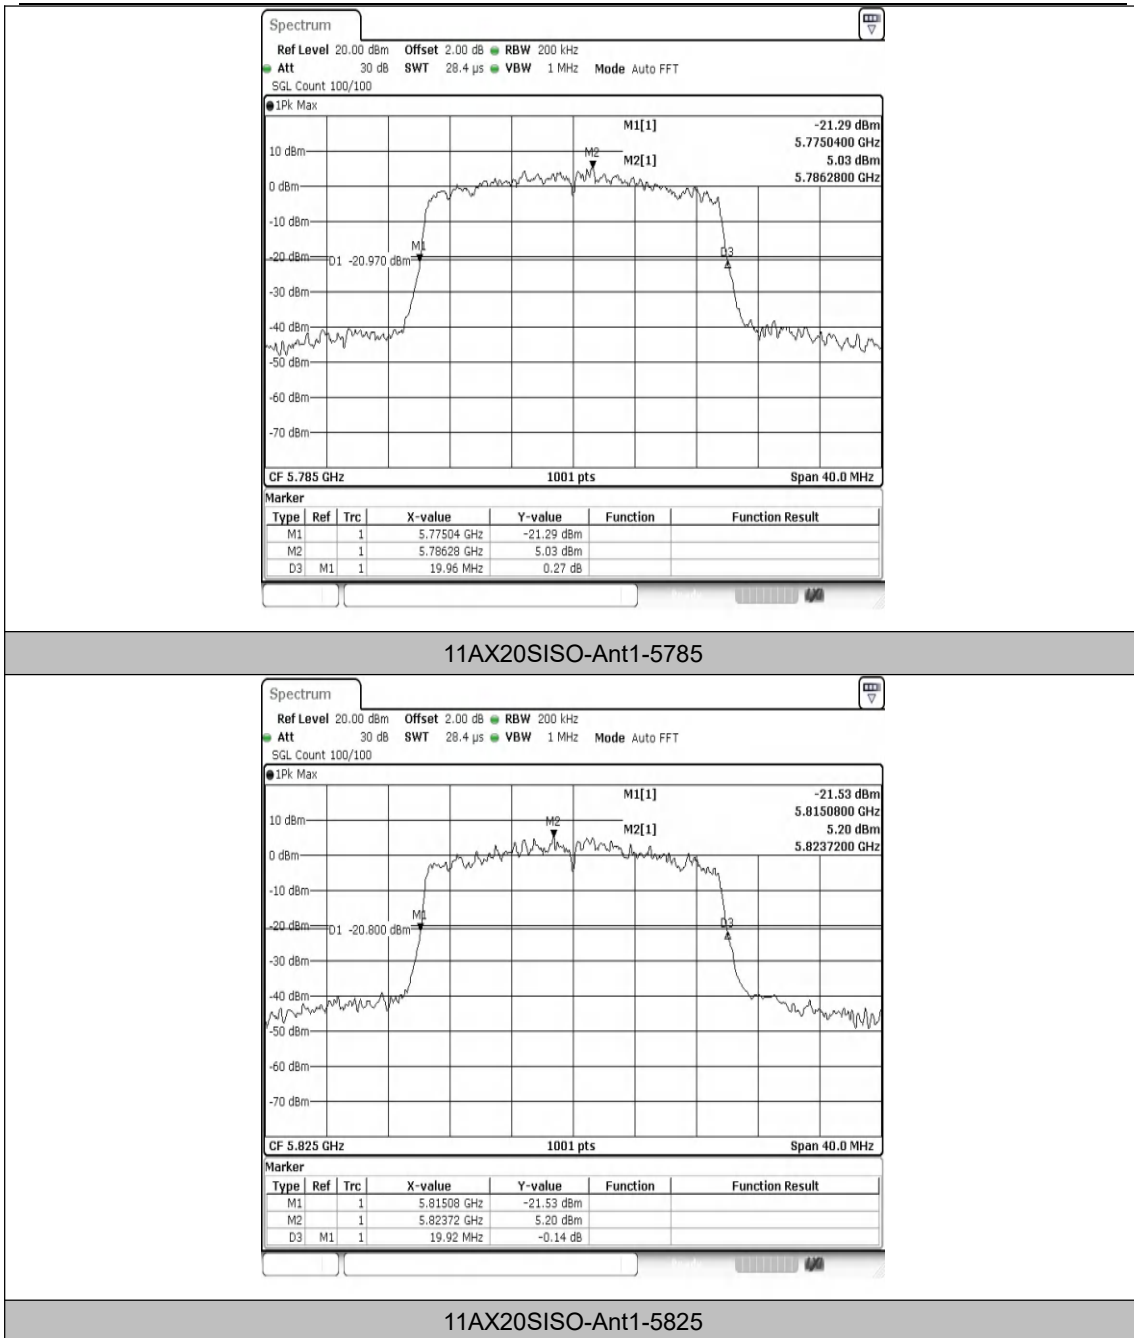





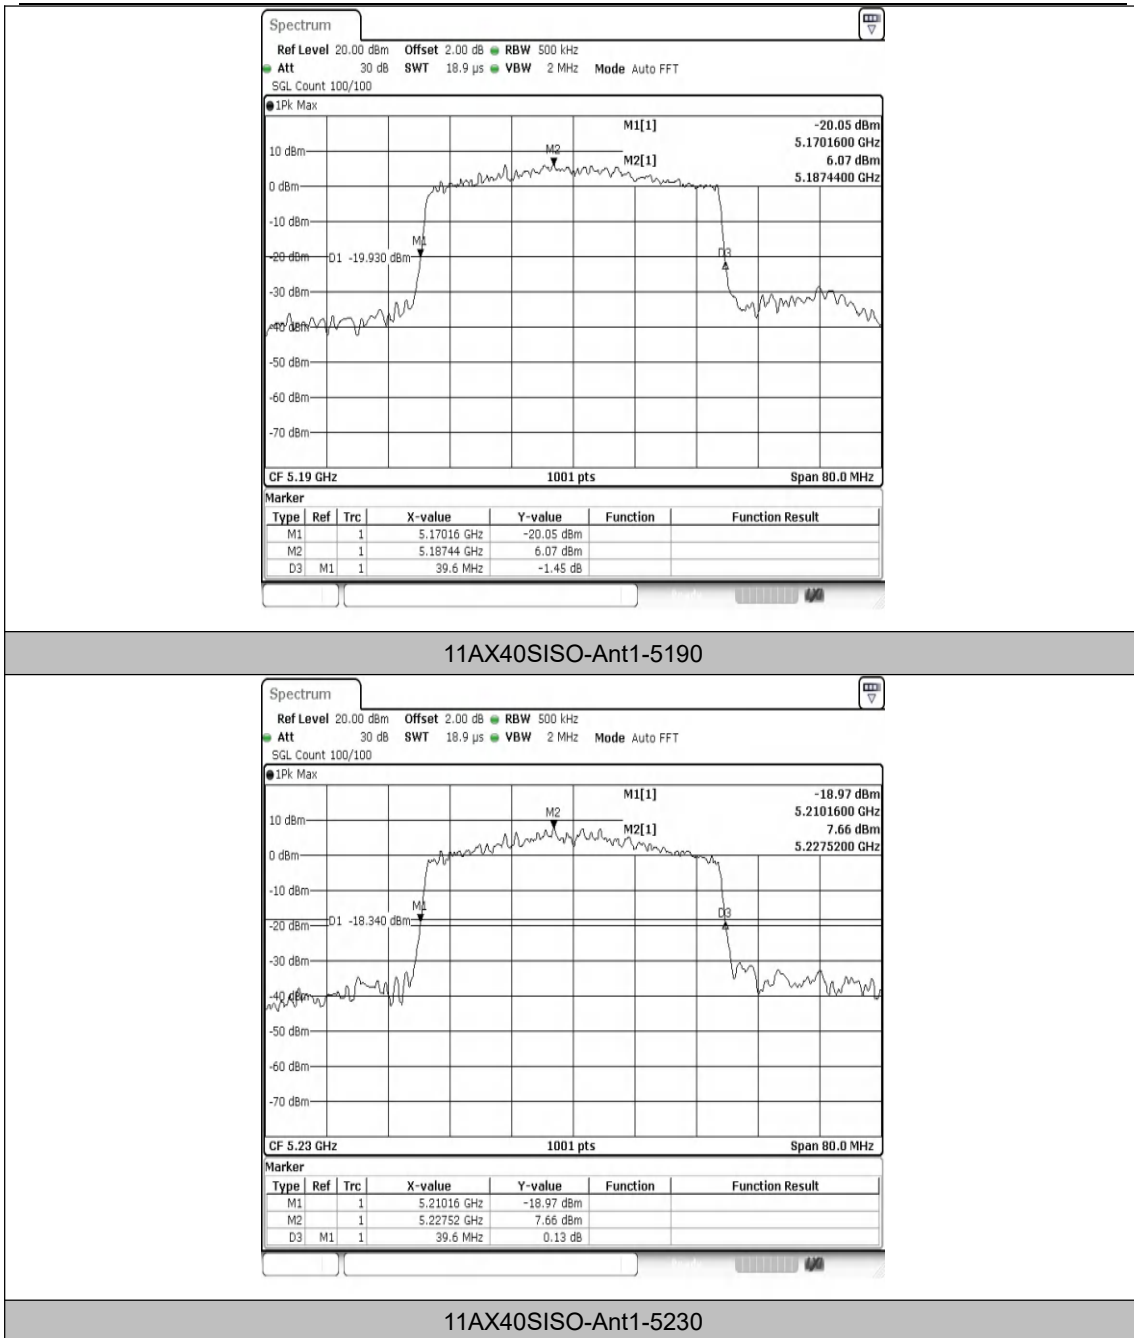

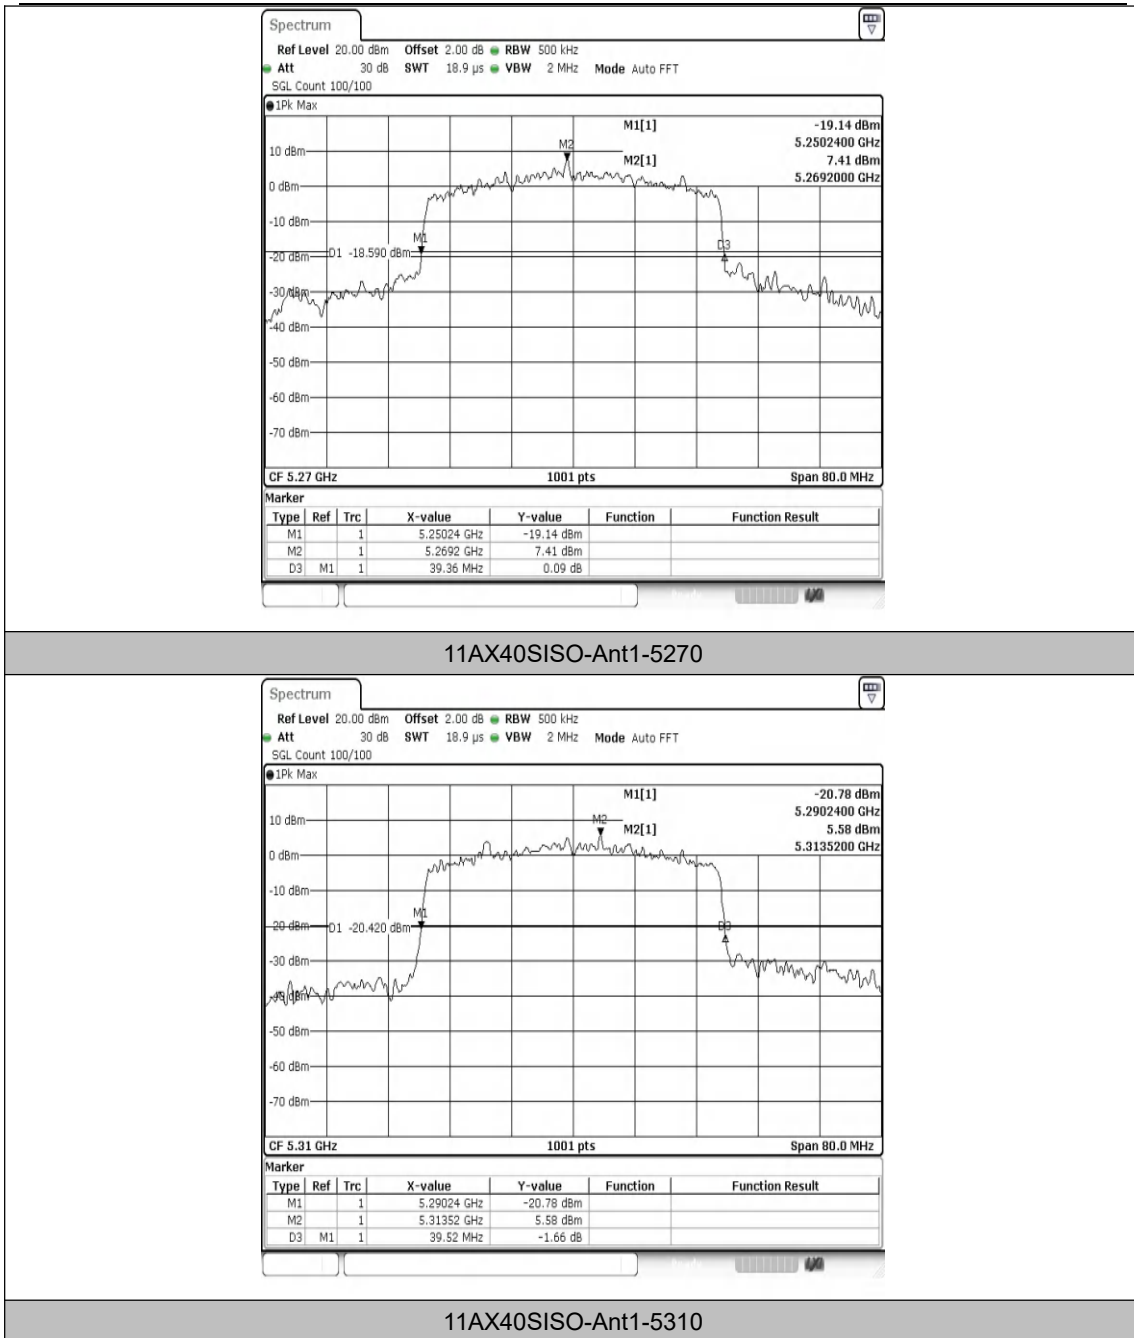

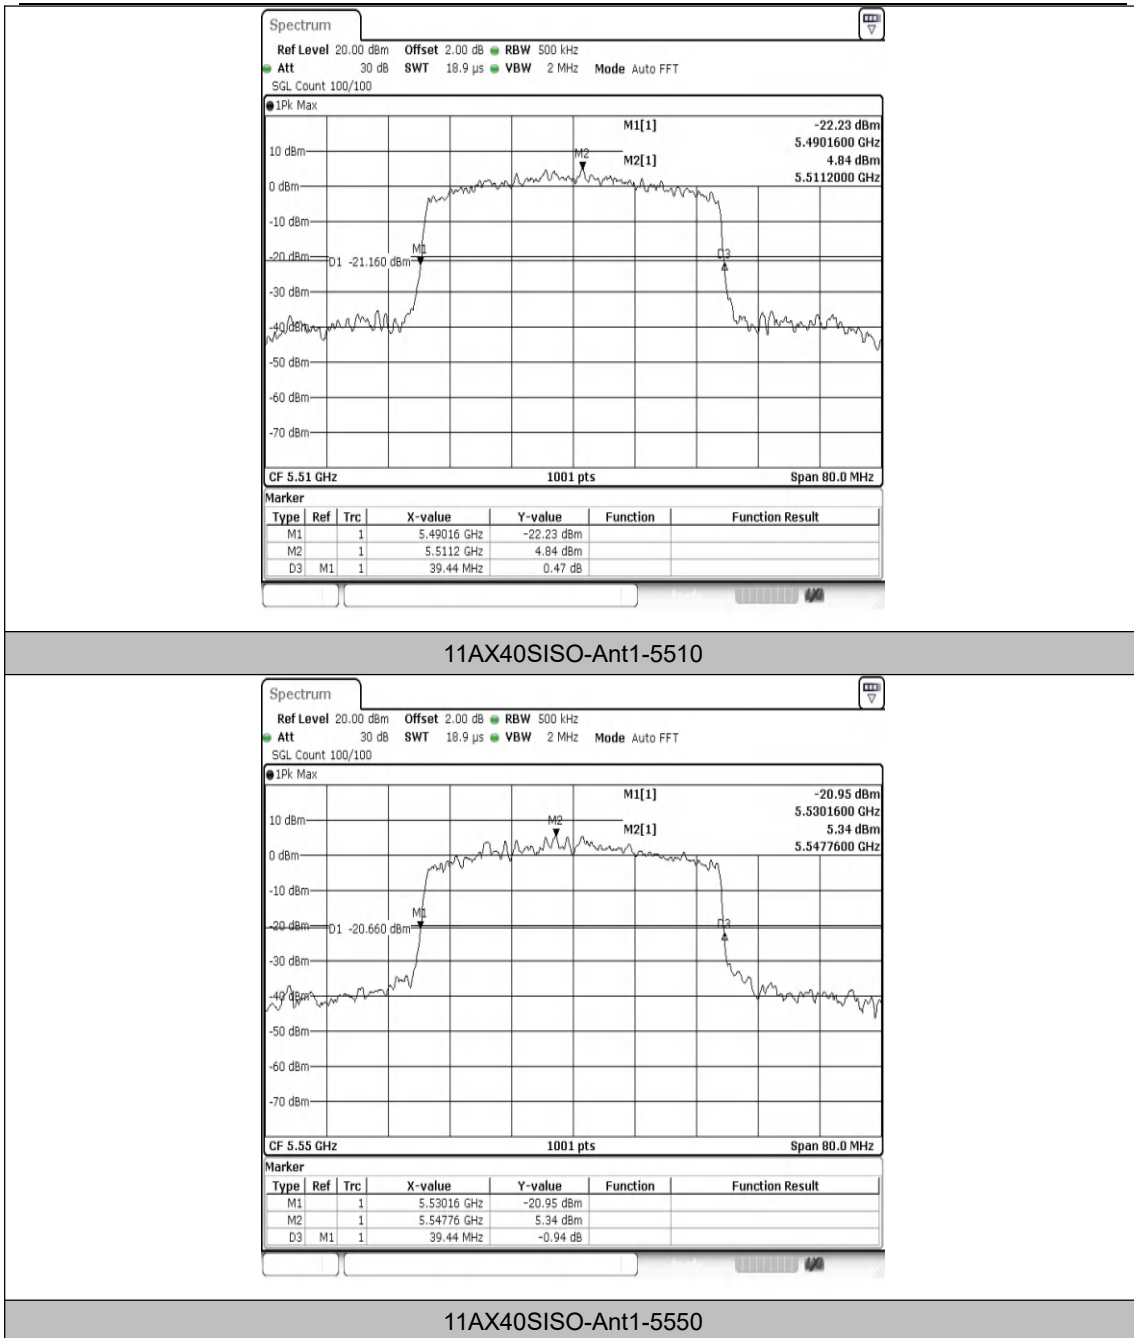

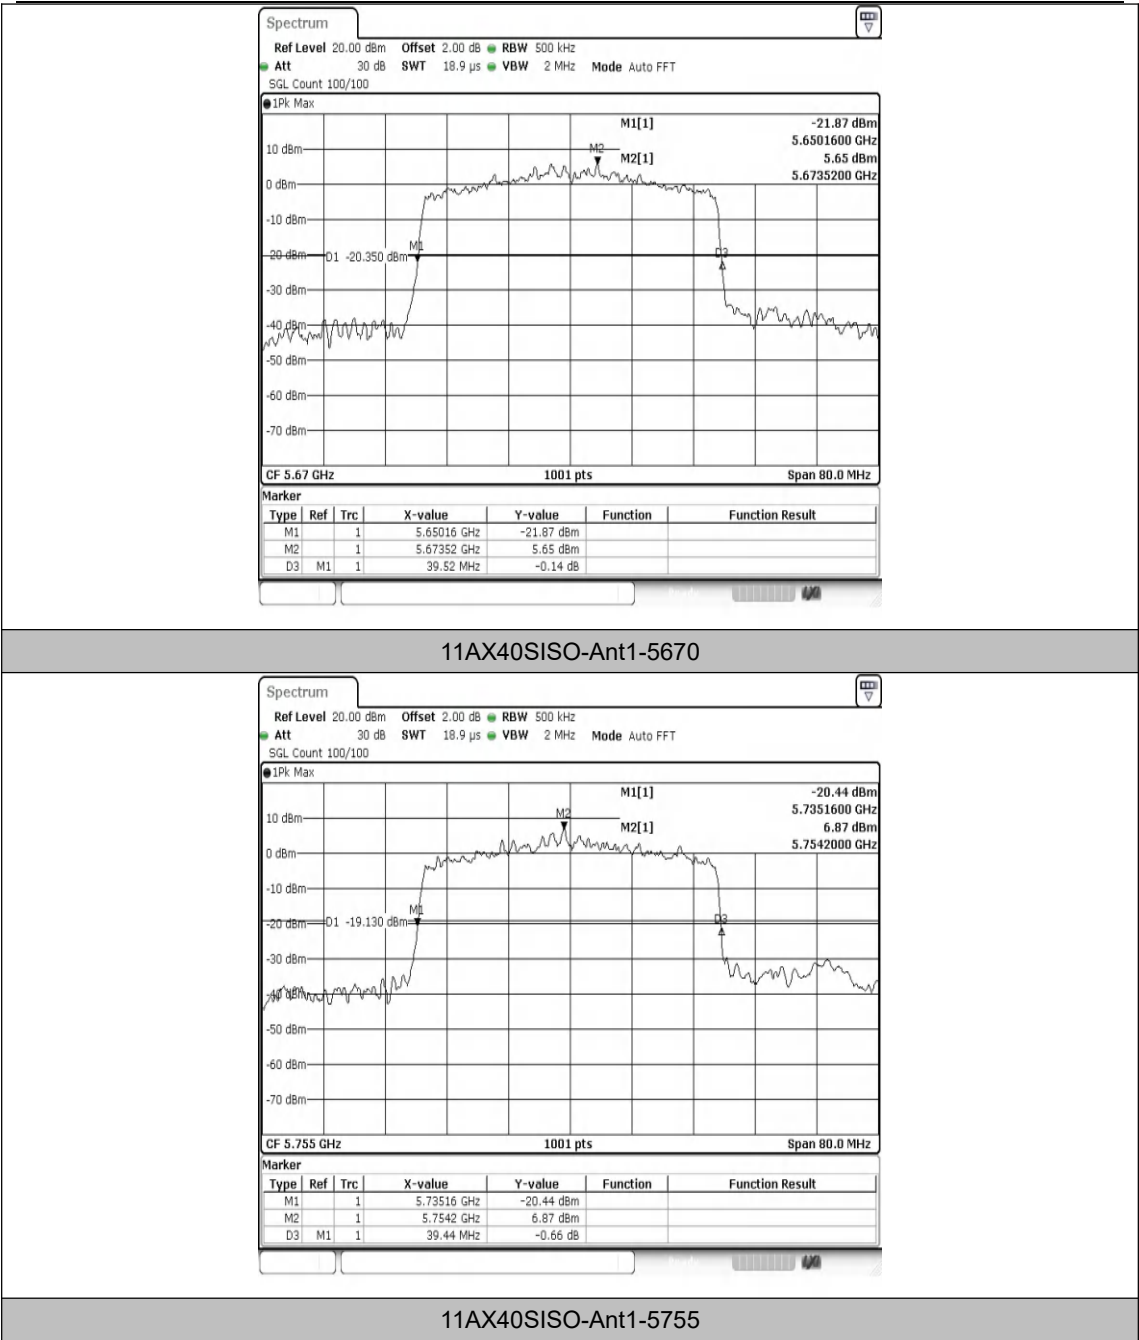

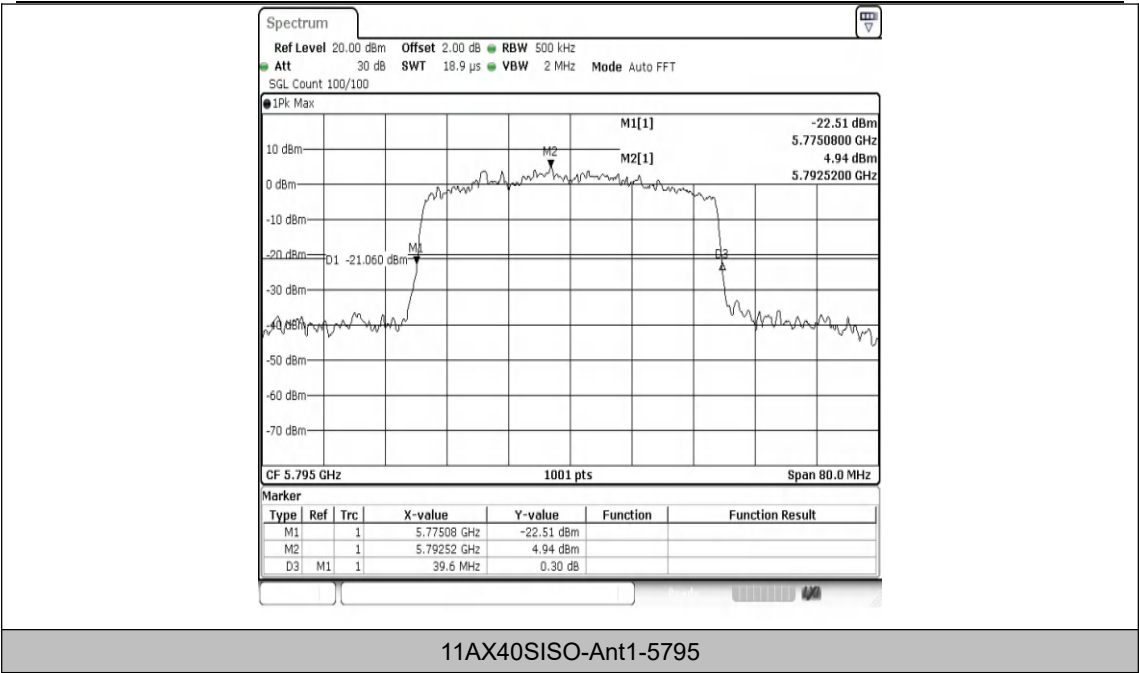

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

## Appendix A2: 99% Occupied Bandwidth

### Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	16.144	5171.9281	5188.0719	---	---
11A	Ant1	5200	16.224	5191.8482	5208.0719	---	---
11A	Ant1	5240	16.264	5231.8082	5248.0719	---	---
11A	Ant1	5260	16.184	5251.8881	5268.0719	---	---
11A	Ant1	5280	16.184	5271.8881	5288.0719	---	---
11A	Ant1	5320	16.144	5311.8881	5328.0320	---	---
11A	Ant1	5500	16.184	5491.8482	5508.0320	---	---
11A	Ant1	5580	16.224	5571.8482	5588.0719	---	---
11A	Ant1	5700	16.144	5691.8881	5708.0320	---	---
11A	Ant1	5745	16.224	5736.8482	5753.0719	---	---
11A	Ant1	5785	16.184	5776.8482	5793.0320	---	---
11A	Ant1	5825	16.224	5816.8482	5833.0719	---	---
11N20SISO	Ant1	5180	17.303	5171.3287	5188.6314	---	---
11N20SISO	Ant1	5200	17.263	5191.3686	5208.6314	---	---
11N20SISO	Ant1	5240	17.303	5231.3287	5248.6314	---	---
11N20SISO	Ant1	5260	17.303	5251.3287	5268.6314	---	---
11N20SISO	Ant1	5280	17.303	5271.3287	5288.6314	---	---
11N20SISO	Ant1	5320	17.303	5311.3287	5328.6314	---	---
11N20SISO	Ant1	5500	17.303	5491.3287	5508.6314	---	---
11N20SISO	Ant1	5580	17.303	5571.3287	5588.6314	---	---
11N20SISO	Ant1	5700	17.303	5691.3287	5708.6314	---	---
11N20SISO	Ant1	5745	17.303	5736.3287	5753.6314	---	---
11N20SISO	Ant1	5785	17.303	5776.3287	5793.6314	---	---
11N20SISO	Ant1	5825	17.303	5816.3287	5833.6314	---	---
11N40SISO	Ant1	5190	35.804	5172.0979	5207.9021	---	---
11N40SISO	Ant1	5230	35.724	5212.0979	5247.8222	---	---
11N40SISO	Ant1	5270	35.724	5252.0979	5287.8222	---	---
11N40SISO	Ant1	5310	35.724	5292.0979	5327.8222	---	---
11N40SISO	Ant1	5510	35.804	5492.0180	5527.8222	---	---
11N40SISO	Ant1	5550	35.644	5532.0979	5567.7423	---	---
11N40SISO	Ant1	5670	35.724	5652.0979	5687.8222	---	---
11N40SISO	Ant1	5755	35.644	5737.0979	5772.7423	---	---
11N40SISO	Ant1	5795	35.644	5777.0979	5812.7423	---	---
11AC20SISO	Ant1	5180	17.383	5171.2887	5188.6713	---	---
11AC20SISO	Ant1	5200	17.343	5191.2887	5208.6314	---	---
11AC20SISO	Ant1	5240	17.383	5231.2887	5248.6713	---	---
11AC20SISO	Ant1	5260	17.383	5251.2488	5268.6314	---	---

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)



11AC20SISO	Ant1	5280	17.343	5271.2887	5288.6314	---	---
11AC20SISO	Ant1	5320	17.423	5311.2488	5328.6713	---	---
11AC20SISO	Ant1	5500	17.423	5491.2488	5508.6713	---	---
11AC20SISO	Ant1	5580	17.423	5571.2488	5588.6713	---	---
11AC20SISO	Ant1	5700	17.383	5691.2887	5708.6713	---	---
11AC20SISO	Ant1	5745	17.343	5736.2887	5753.6314	---	---
11AC20SISO	Ant1	5785	17.383	5776.2887	5793.6713	---	---
11AC20SISO	Ant1	5825	17.343	5816.2887	5833.6314	---	---
11AC40SISO	Ant1	5190	35.564	5172.2577	5207.8222	---	---
11AC40SISO	Ant1	5230	35.485	5212.1778	5247.6623	---	---
11AC40SISO	Ant1	5270	35.485	5252.2577	5287.7423	---	---
11AC40SISO	Ant1	5310	35.485	5292.2577	5327.7423	---	---
11AC40SISO	Ant1	5510	35.325	5492.2577	5527.5824	---	---
11AC40SISO	Ant1	5550	35.485	5532.2577	5567.7423	---	---
11AC40SISO	Ant1	5670	35.405	5652.2577	5687.6623	---	---
11AC40SISO	Ant1	5755	35.485	5737.2577	5772.7423	---	---
11AC40SISO	Ant1	5795	35.485	5777.2577	5812.7423	---	---
11AX20SISO	Ant1	5180	18.661	5170.5694	5189.2308	---	---
11AX20SISO	Ant1	5200	18.541	5190.6494	5209.1908	---	---
11AX20SISO	Ant1	5240	18.581	5230.6094	5249.1908	---	---
11AX20SISO	Ant1	5260	18.621	5250.5694	5269.1908	---	---
11AX20SISO	Ant1	5280	18.581	5270.6094	5289.1908	---	---
11AX20SISO	Ant1	5320	18.581	5310.6094	5329.1908	---	---
11AX20SISO	Ant1	5500	18.581	5490.5694	5509.1508	---	---
11AX20SISO	Ant1	5580	18.581	5570.6094	5589.1908	---	---
11AX20SISO	Ant1	5700	18.621	5690.6094	5709.2308	---	---
11AX20SISO	Ant1	5745	18.621	5735.6094	5754.2308	---	---
11AX20SISO	Ant1	5785	18.581	5775.6094	5794.1908	---	---
11AX20SISO	Ant1	5825	18.661	5815.5694	5834.2308	---	---
11AX40SISO	Ant1	5190	37.003	5171.5385	5208.5415	---	---
11AX40SISO	Ant1	5230	36.923	5211.5385	5248.4615	---	---
11AX40SISO	Ant1	5270	37.243	5251.4585	5288.7013	---	---
11AX40SISO	Ant1	5310	37.163	5291.5385	5328.7013	---	---
11AX40SISO	Ant1	5510	36.923	5491.5385	5528.4615	---	---
11AX40SISO	Ant1	5550	37.163	5531.4585	5568.6214	---	---
11AX40SISO	Ant1	5670	37.003	5651.5385	5688.5415	---	---
11AX40SISO	Ant1	5755	37.003	5736.5385	5773.5415	---	---
11AX40SISO	Ant1	5795	36.923	5776.5385	5813.4615	---	---




## Test Graphs

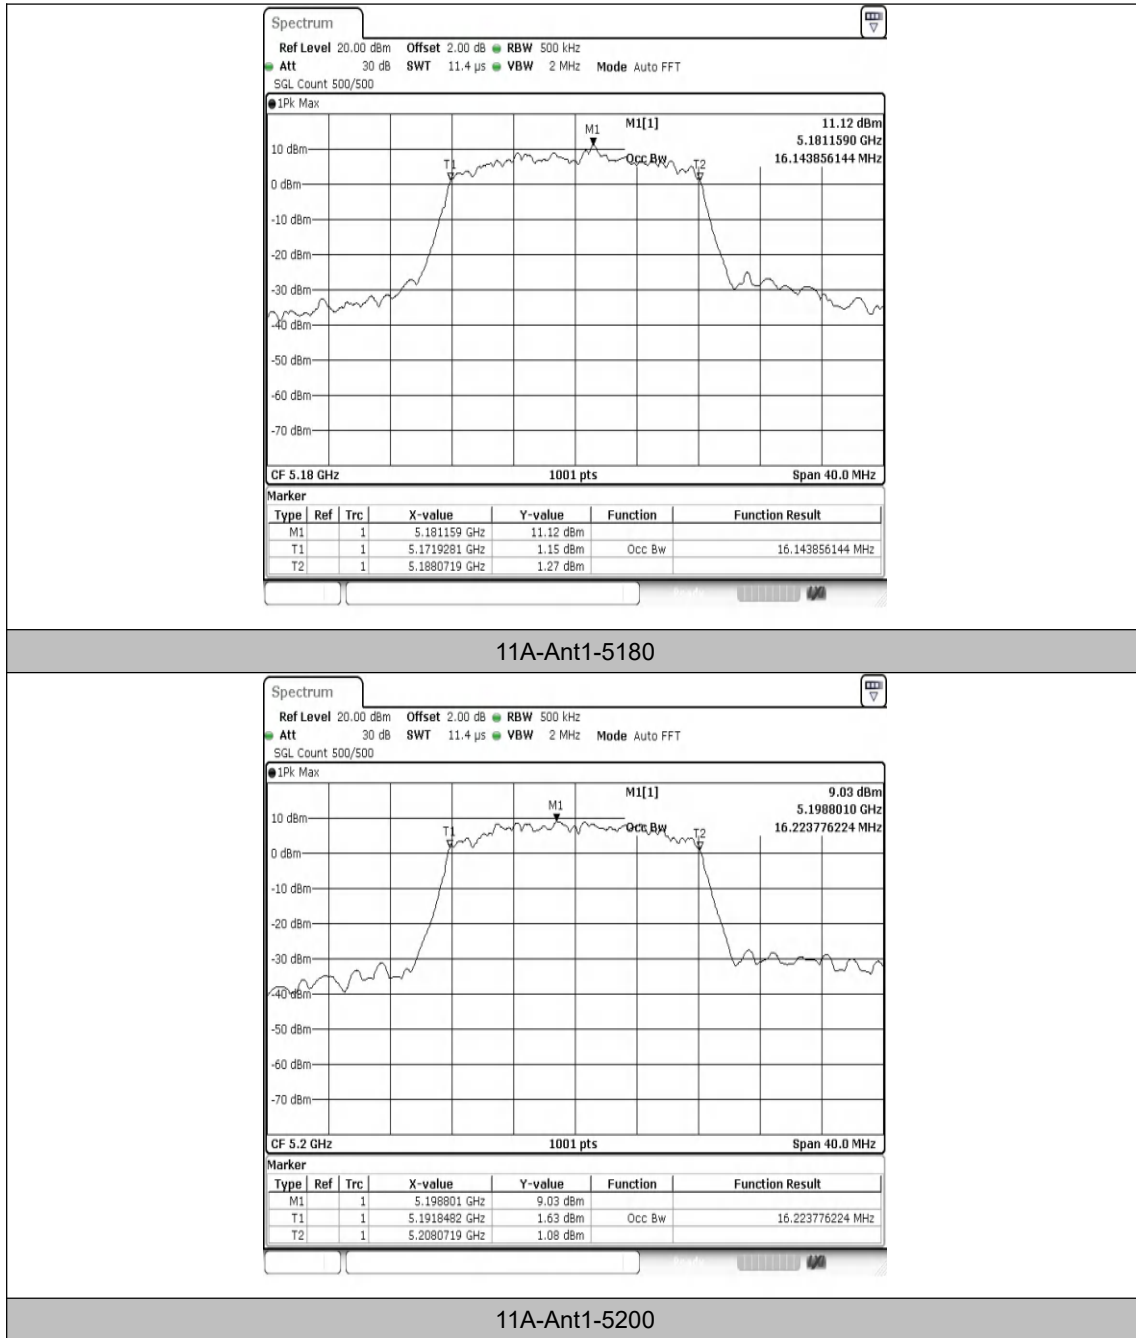


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

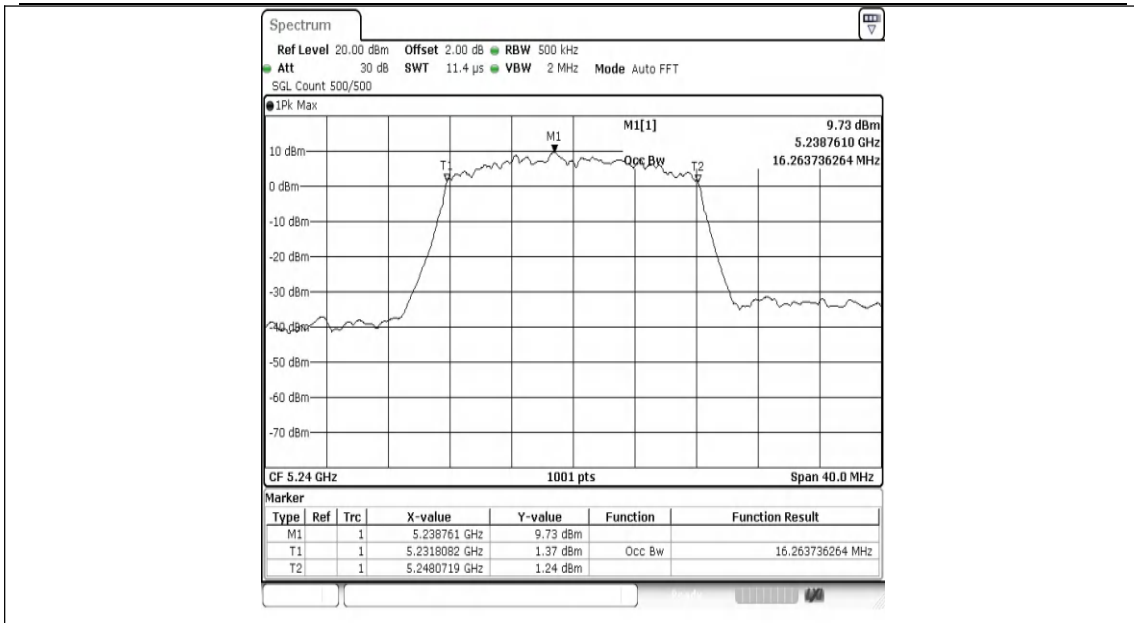

11A-Ant1-5240

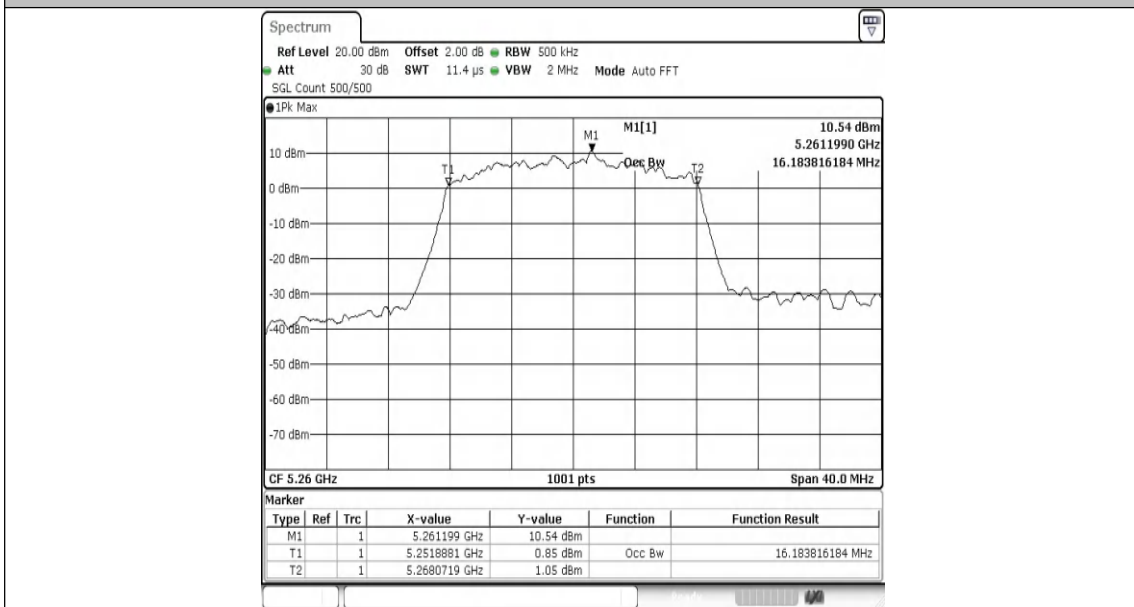


11A-Ant1-5260

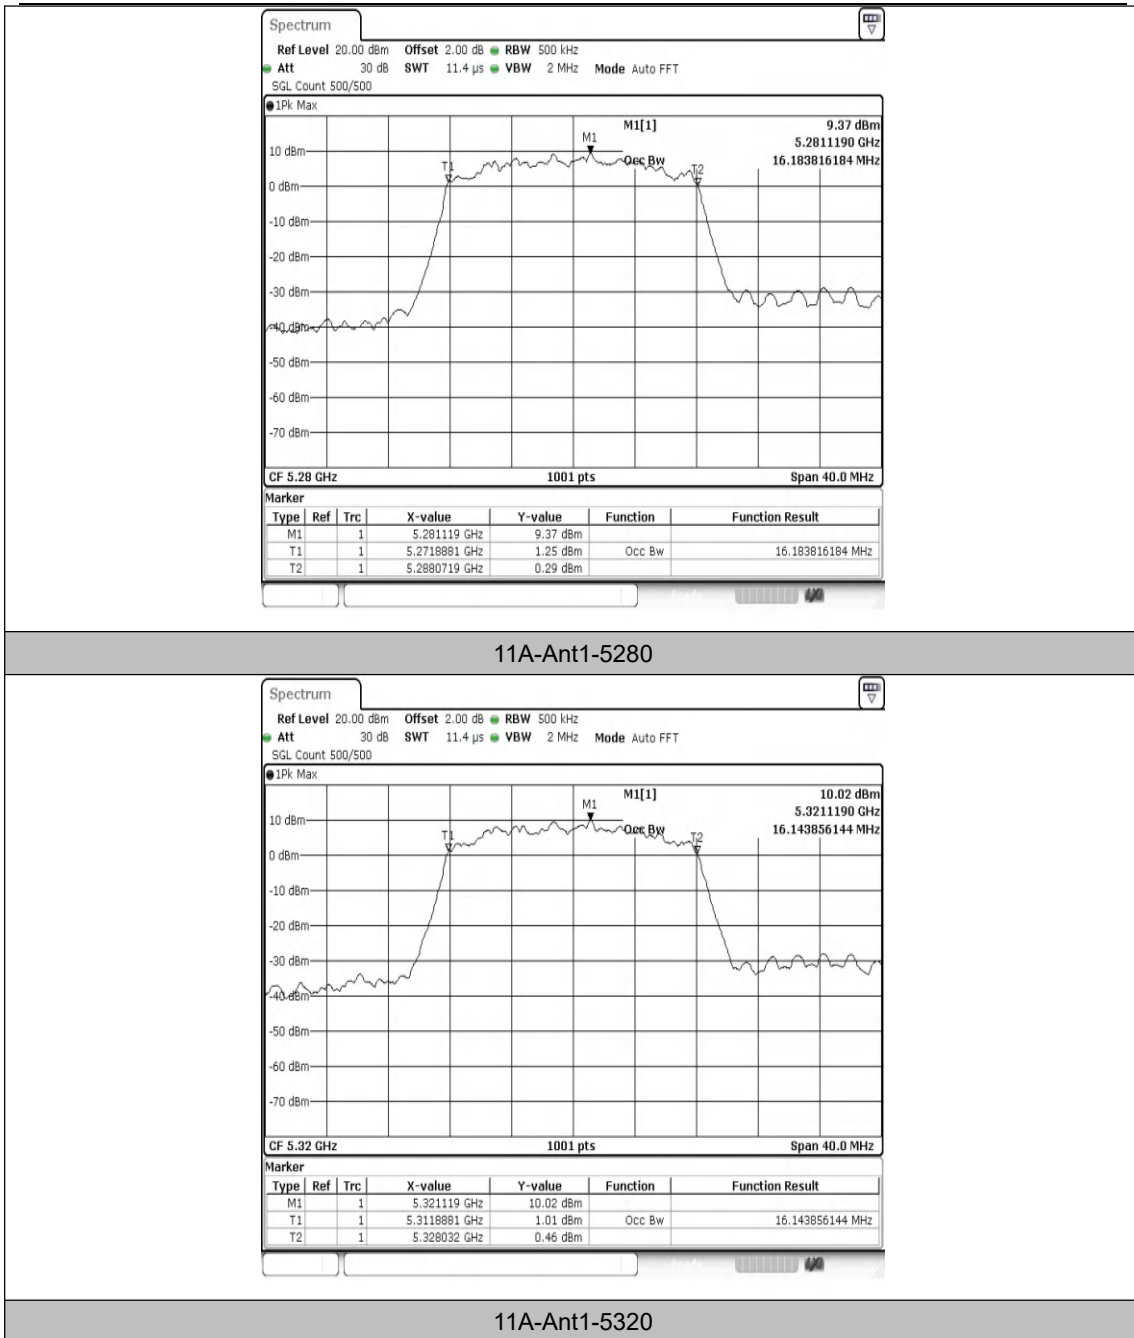


#### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

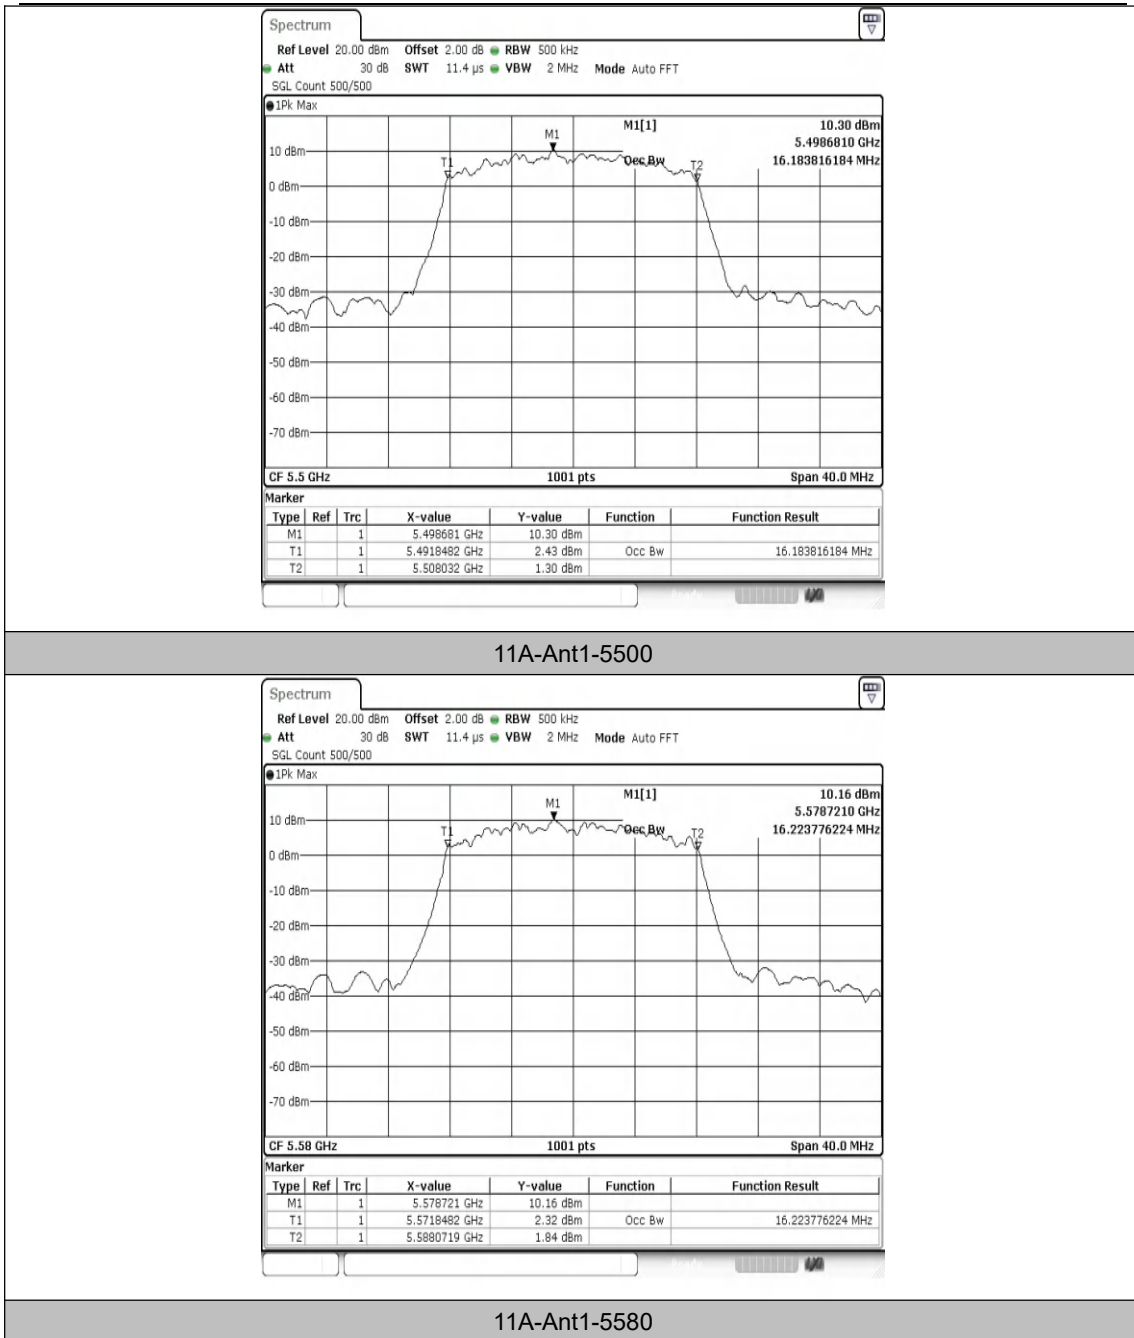


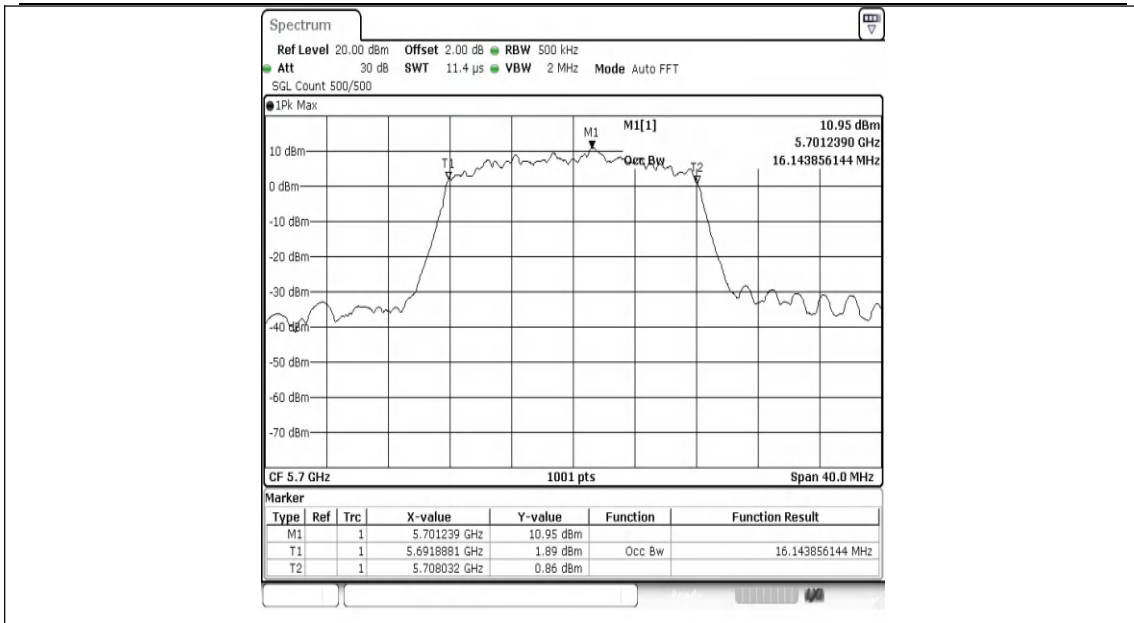


11A-Ant1-5700

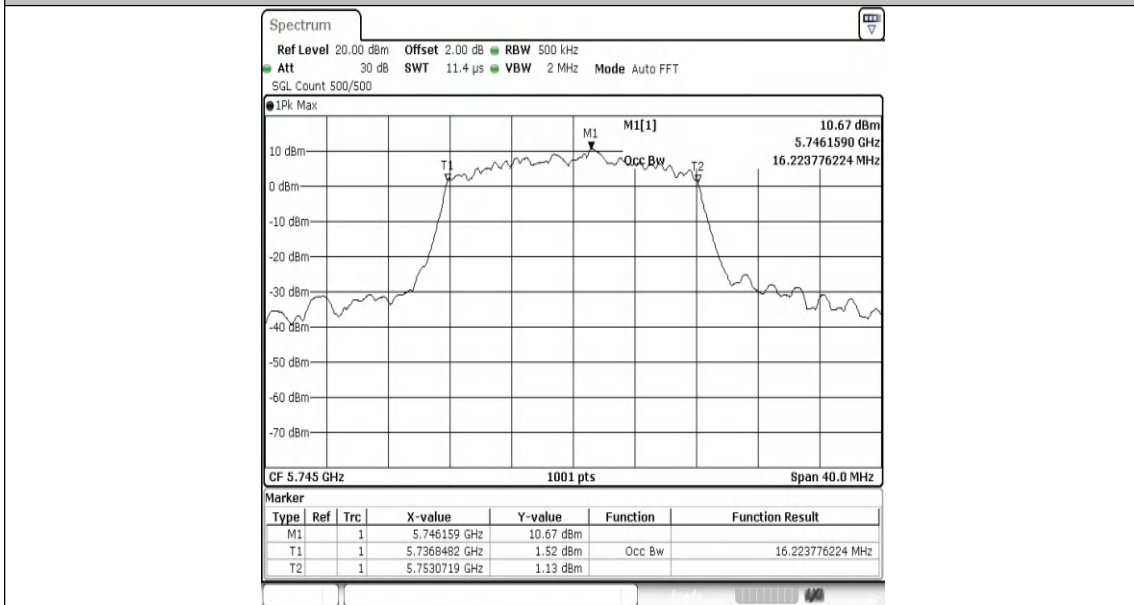



11A-Ant1-5745

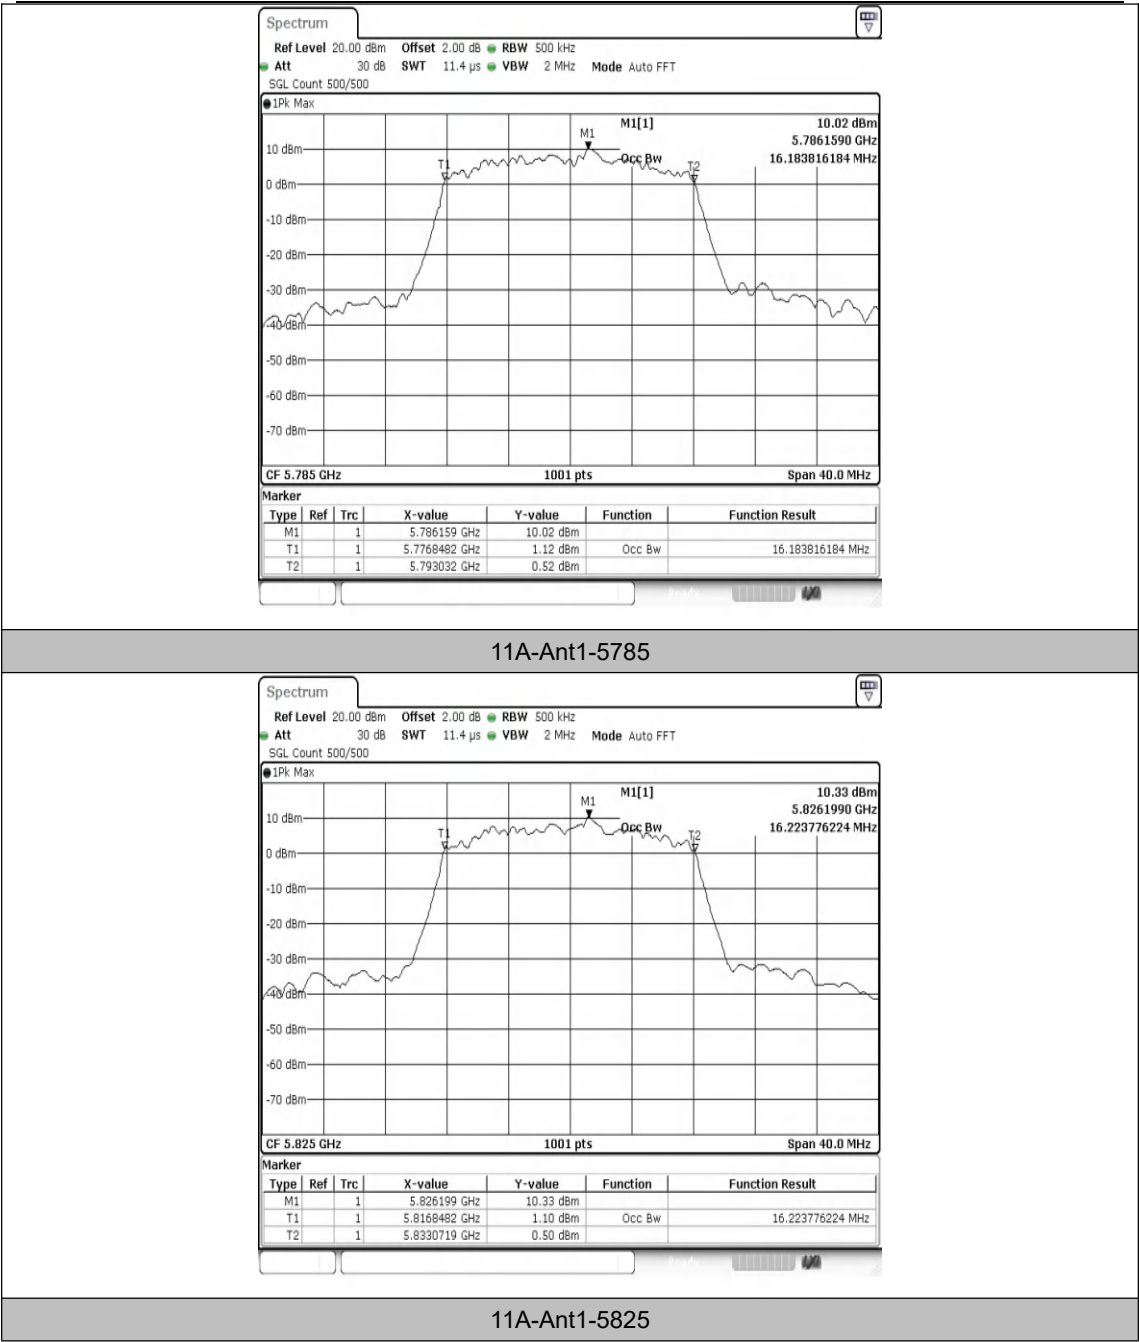


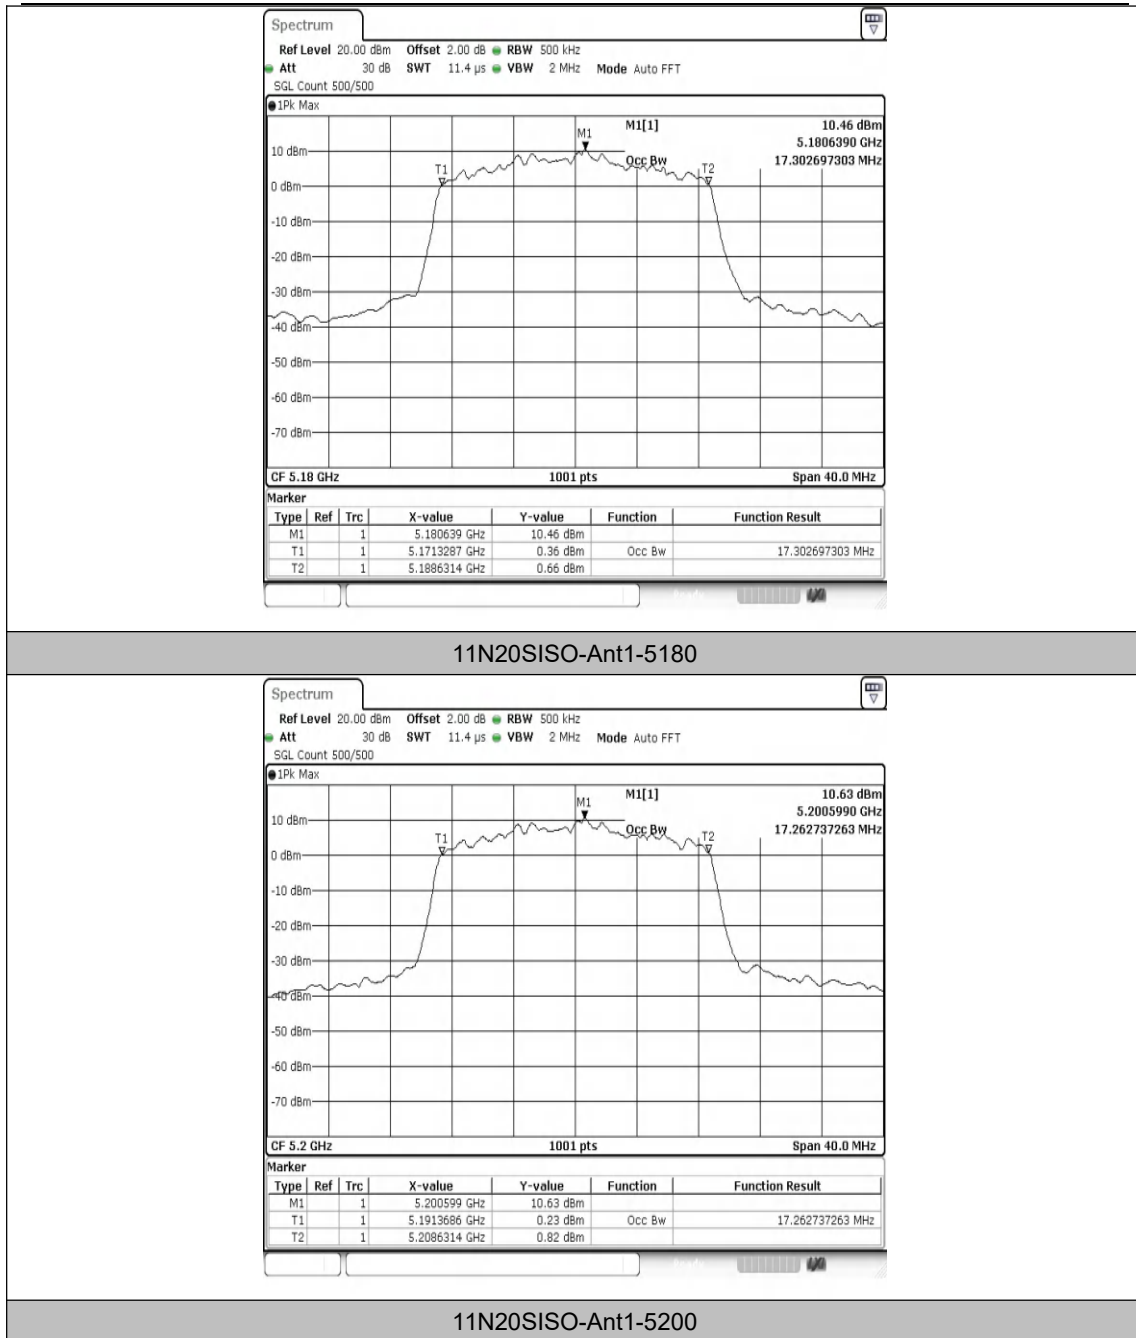





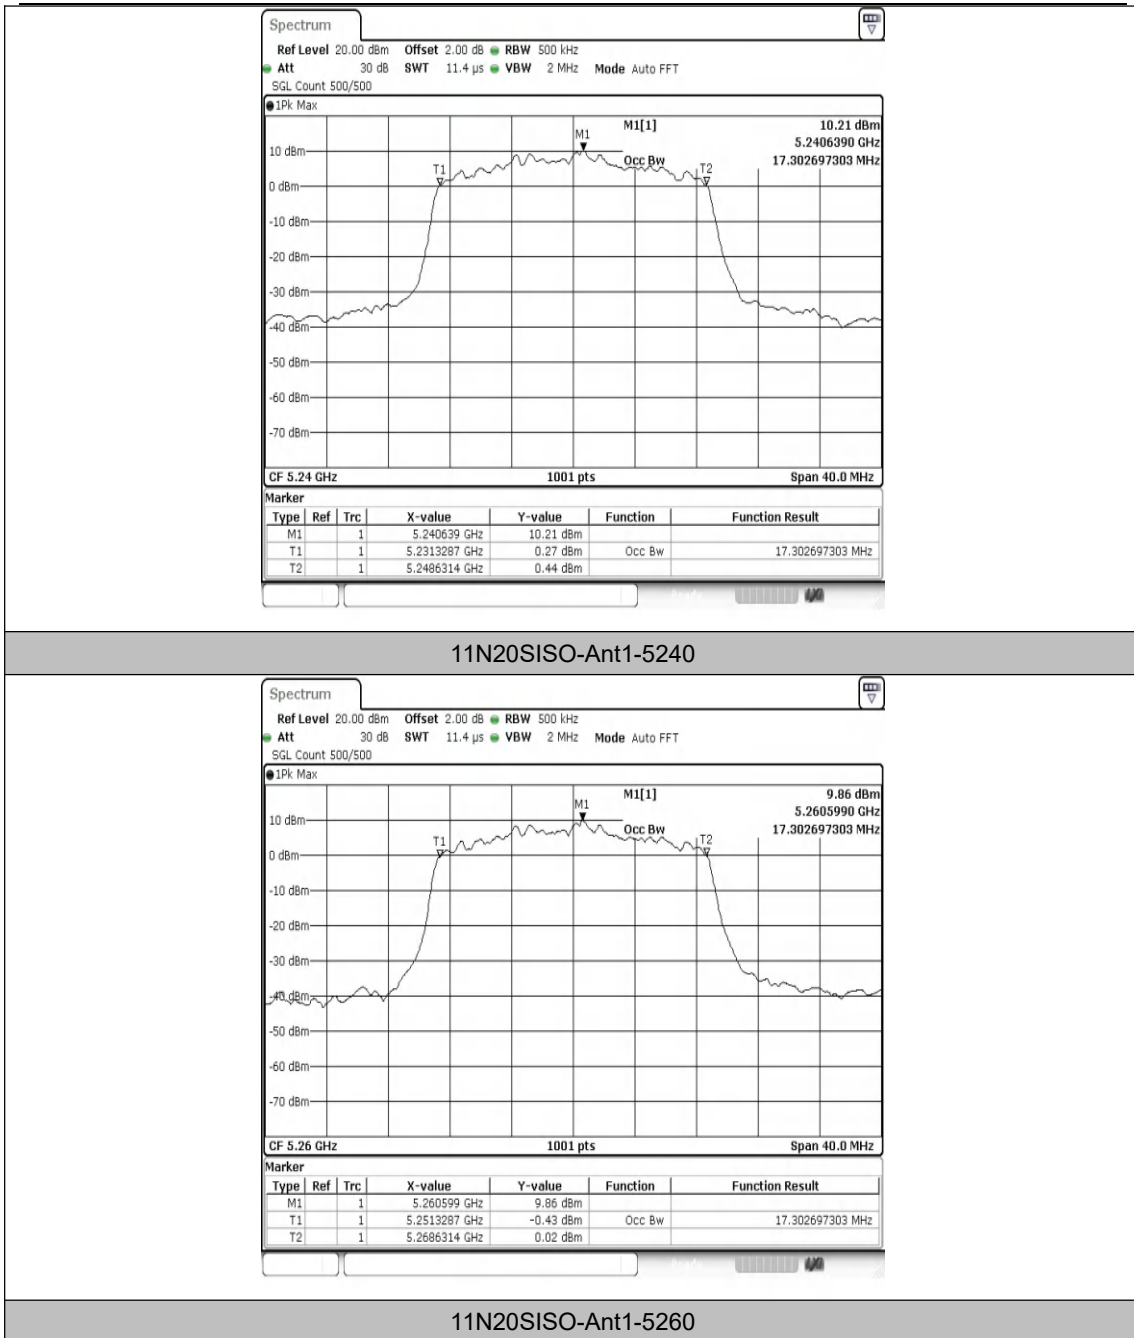


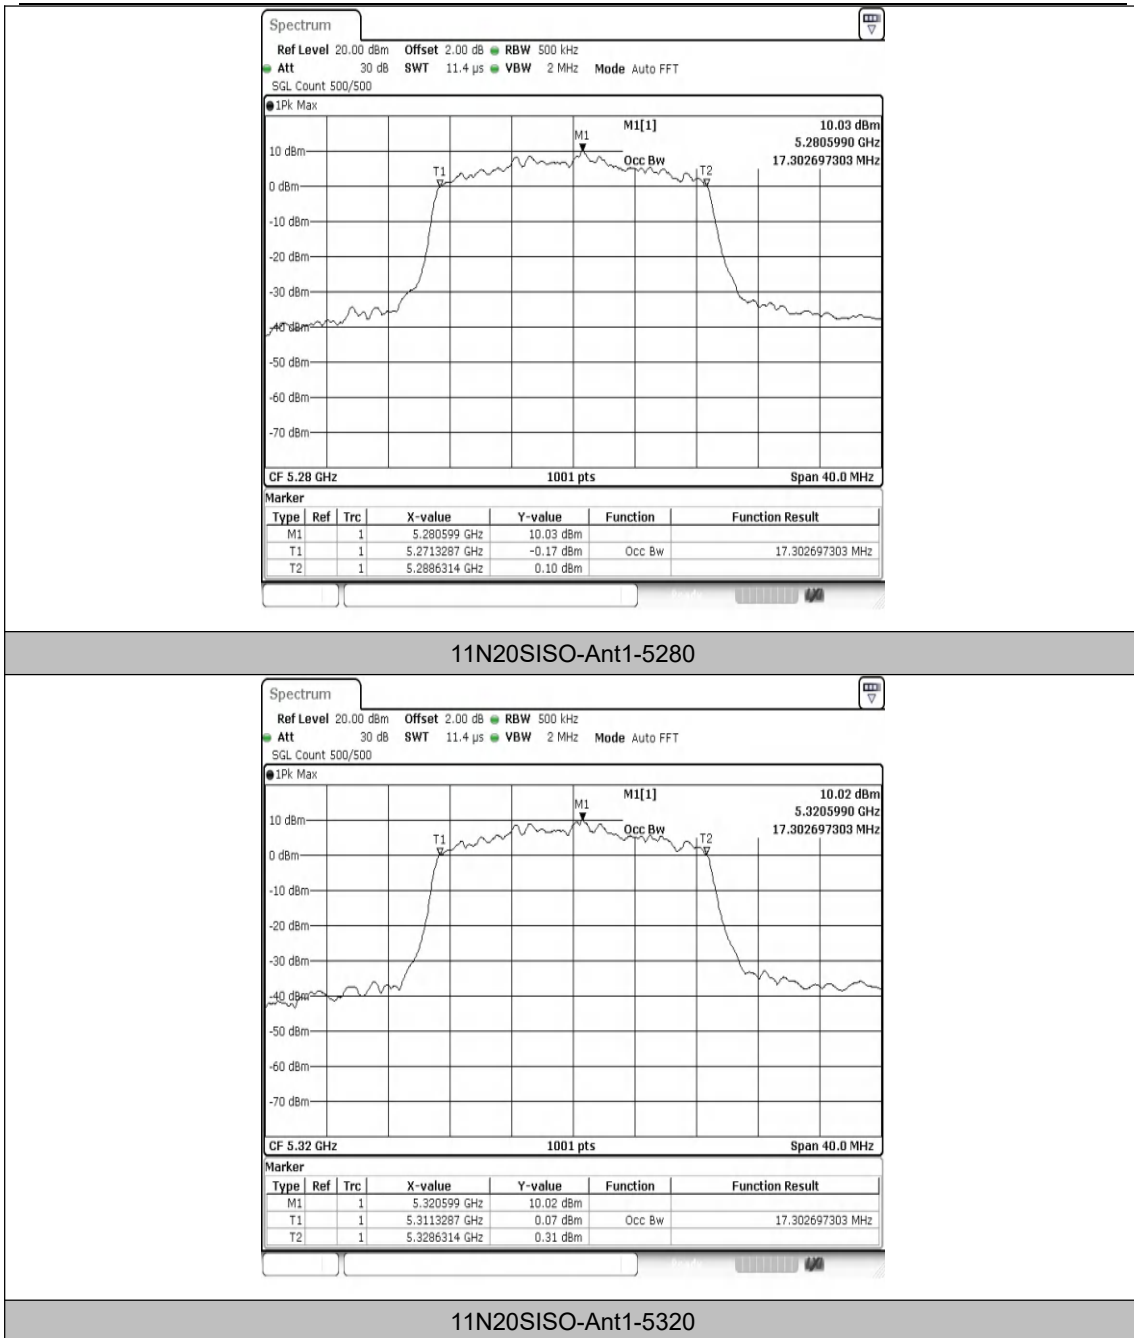


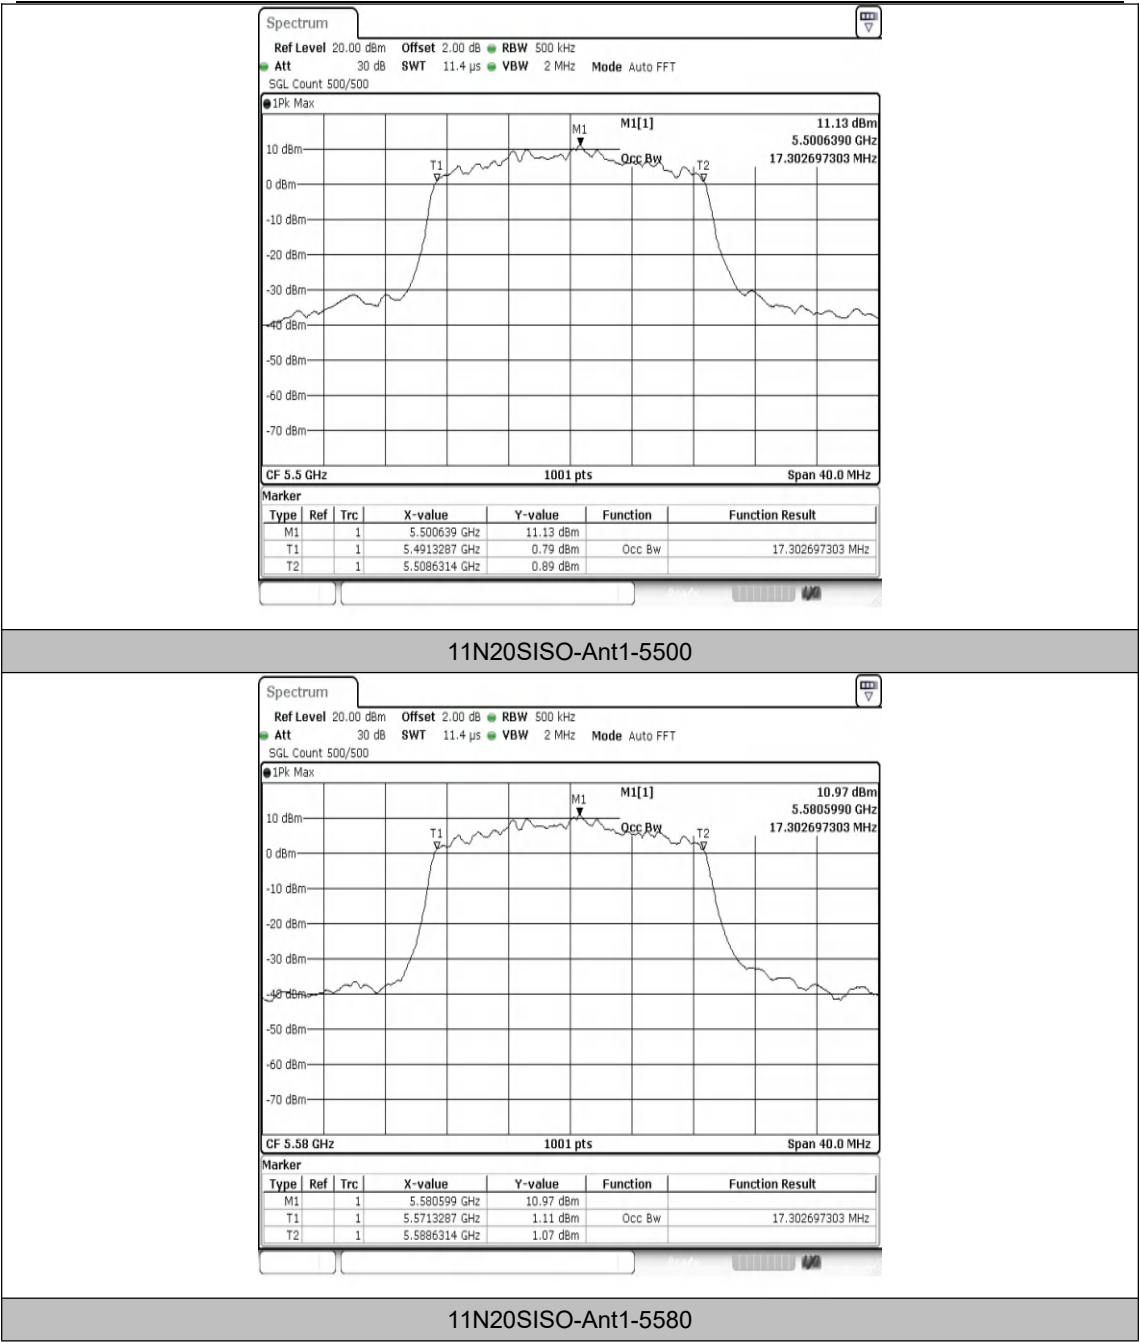

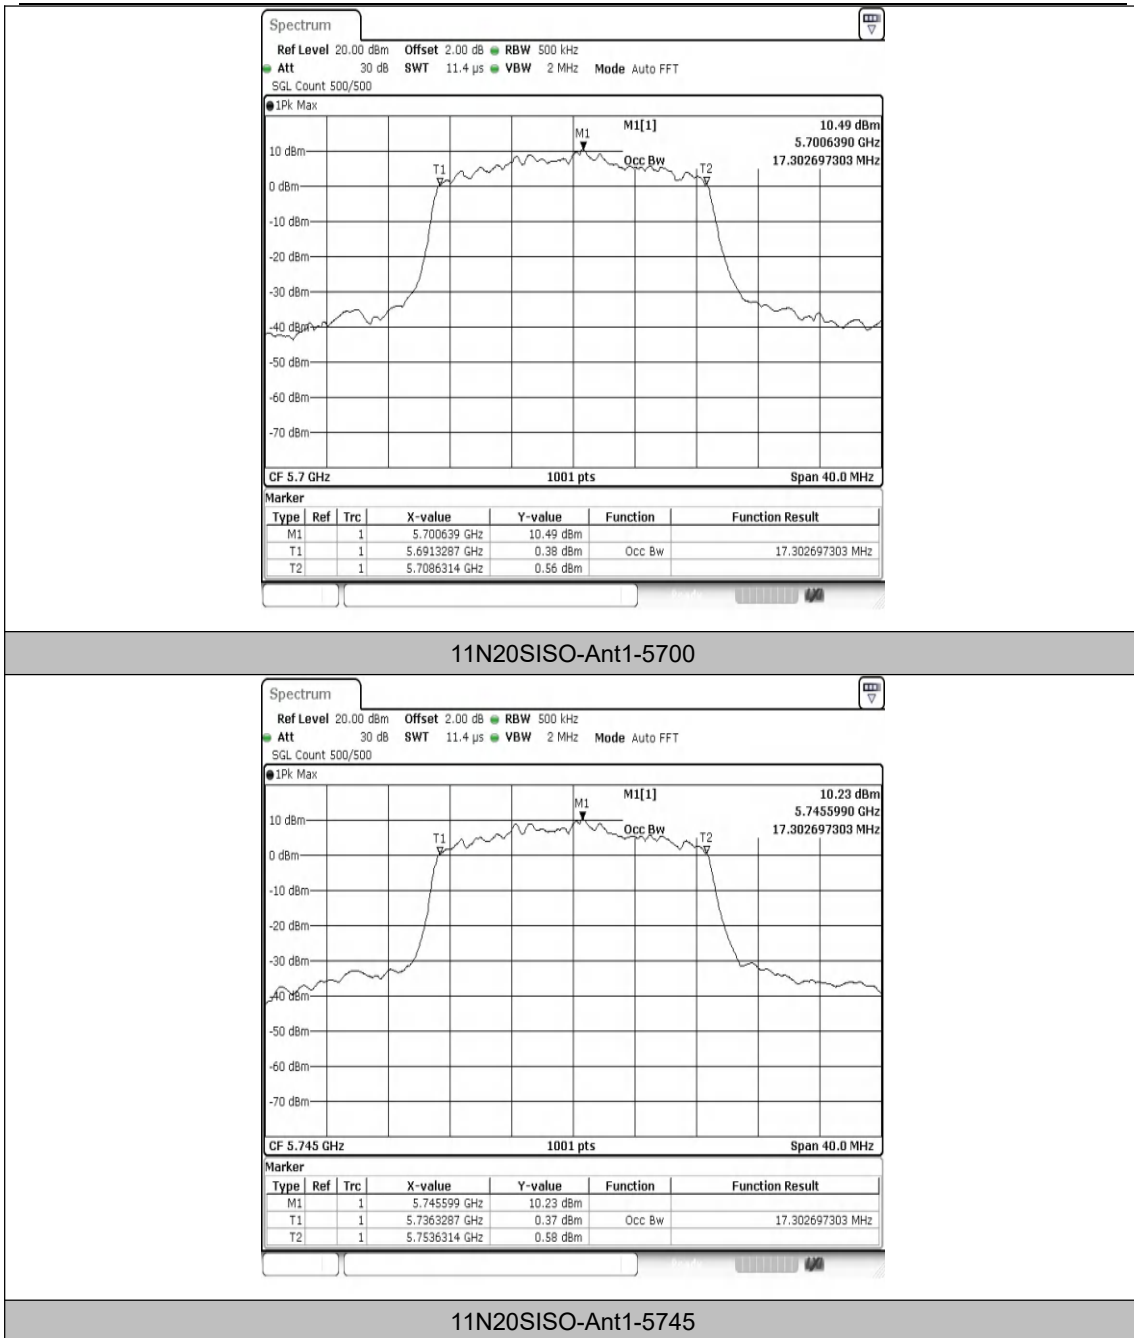


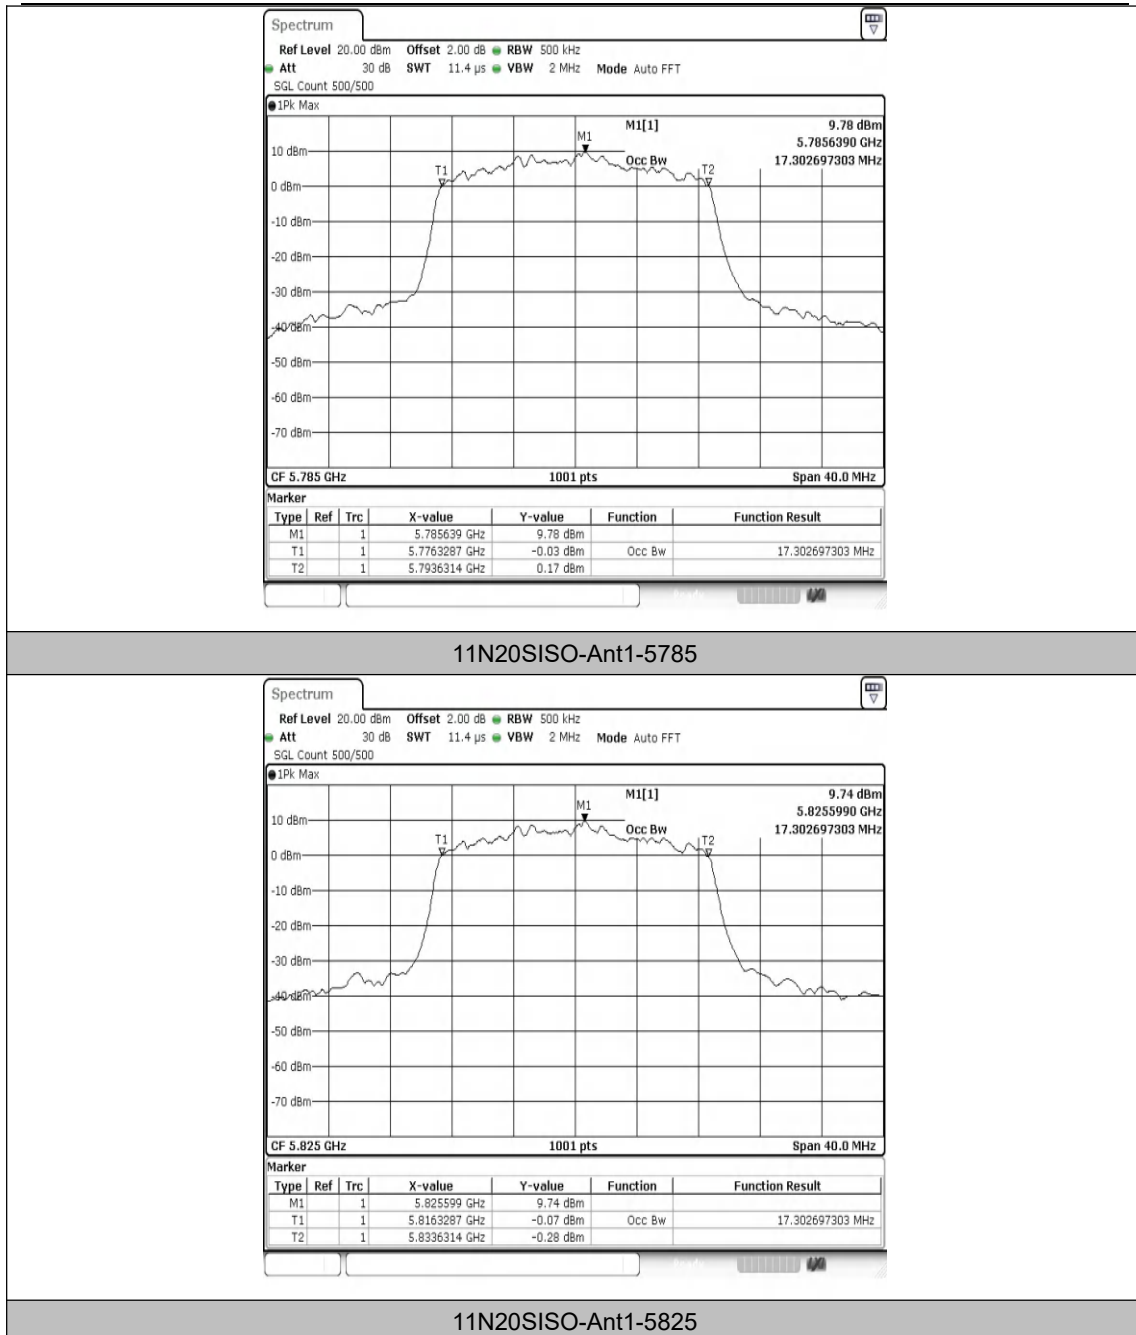


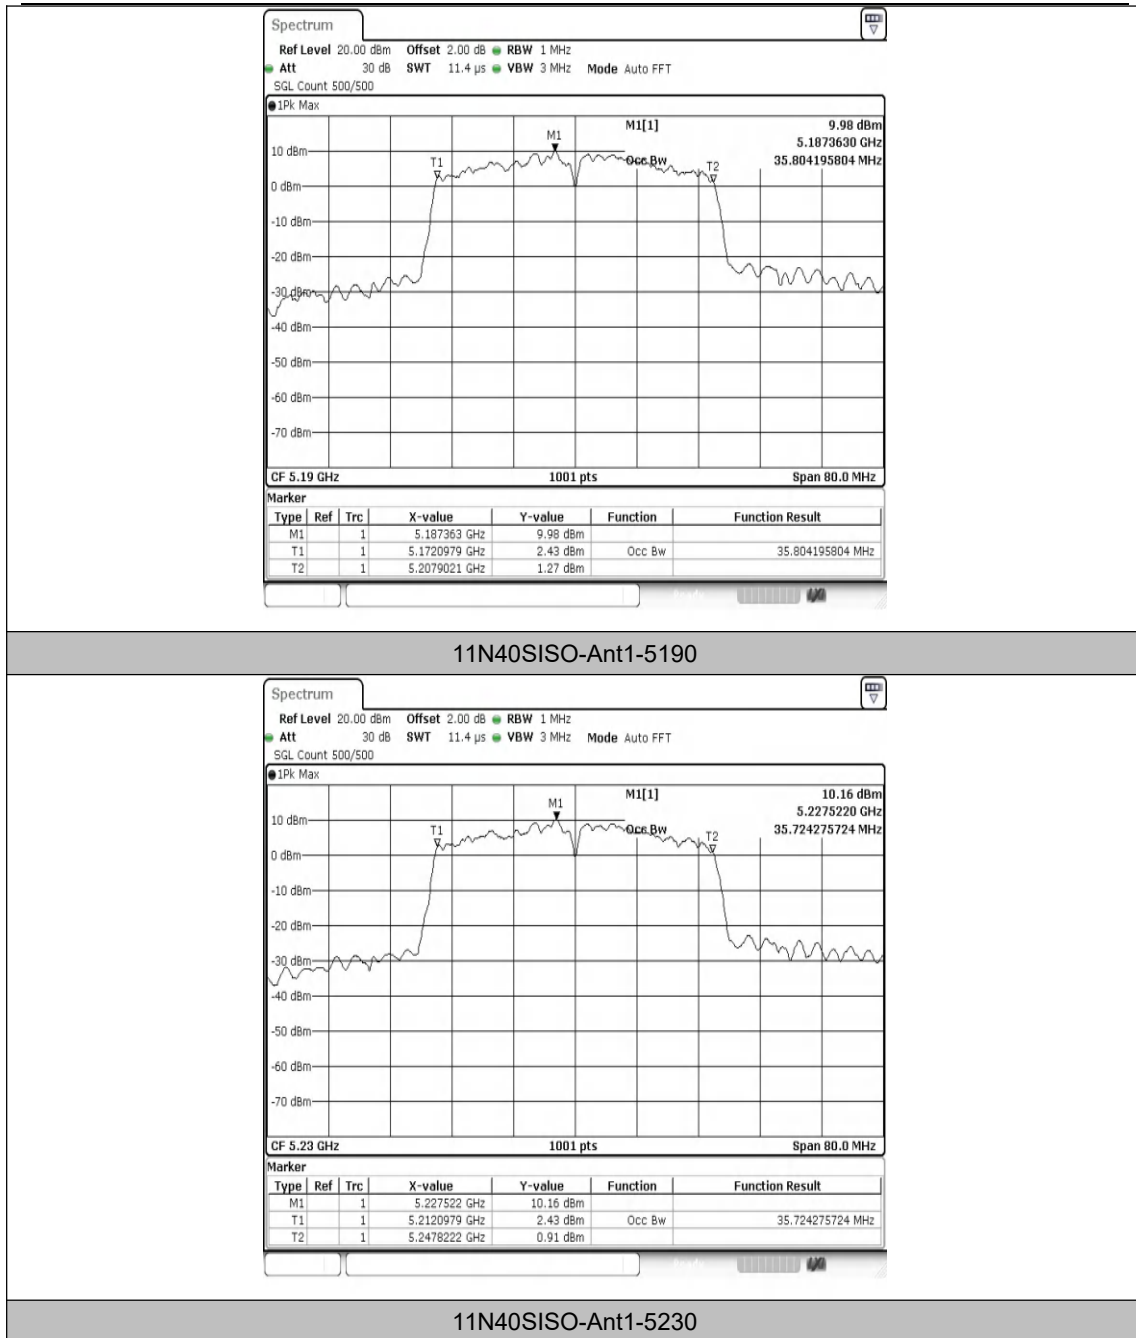


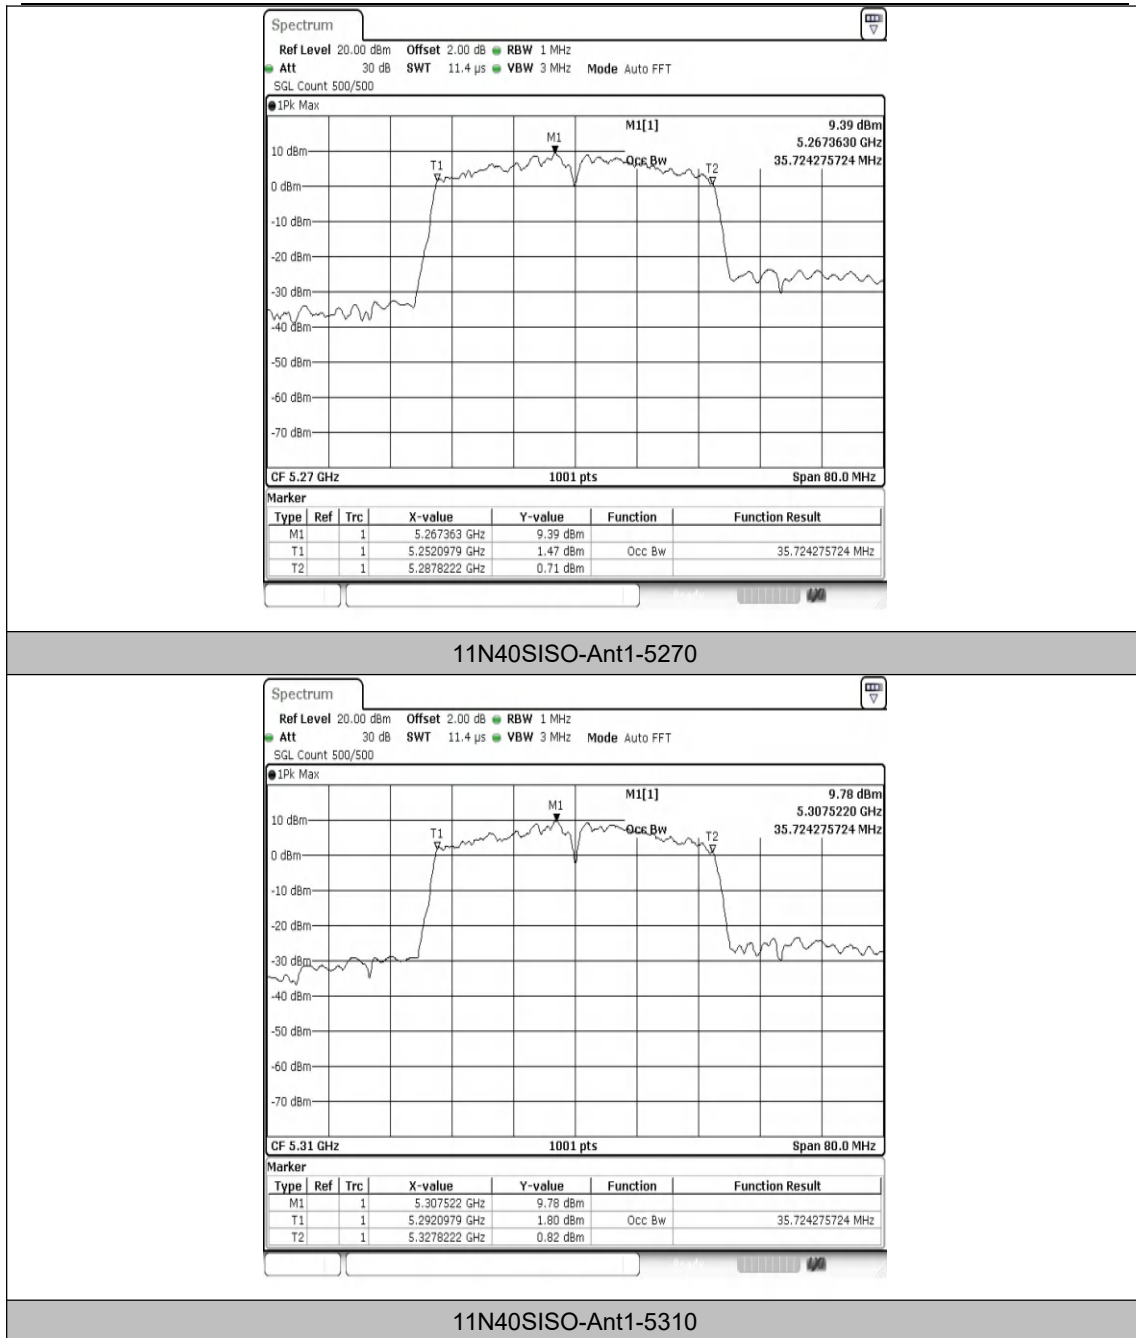



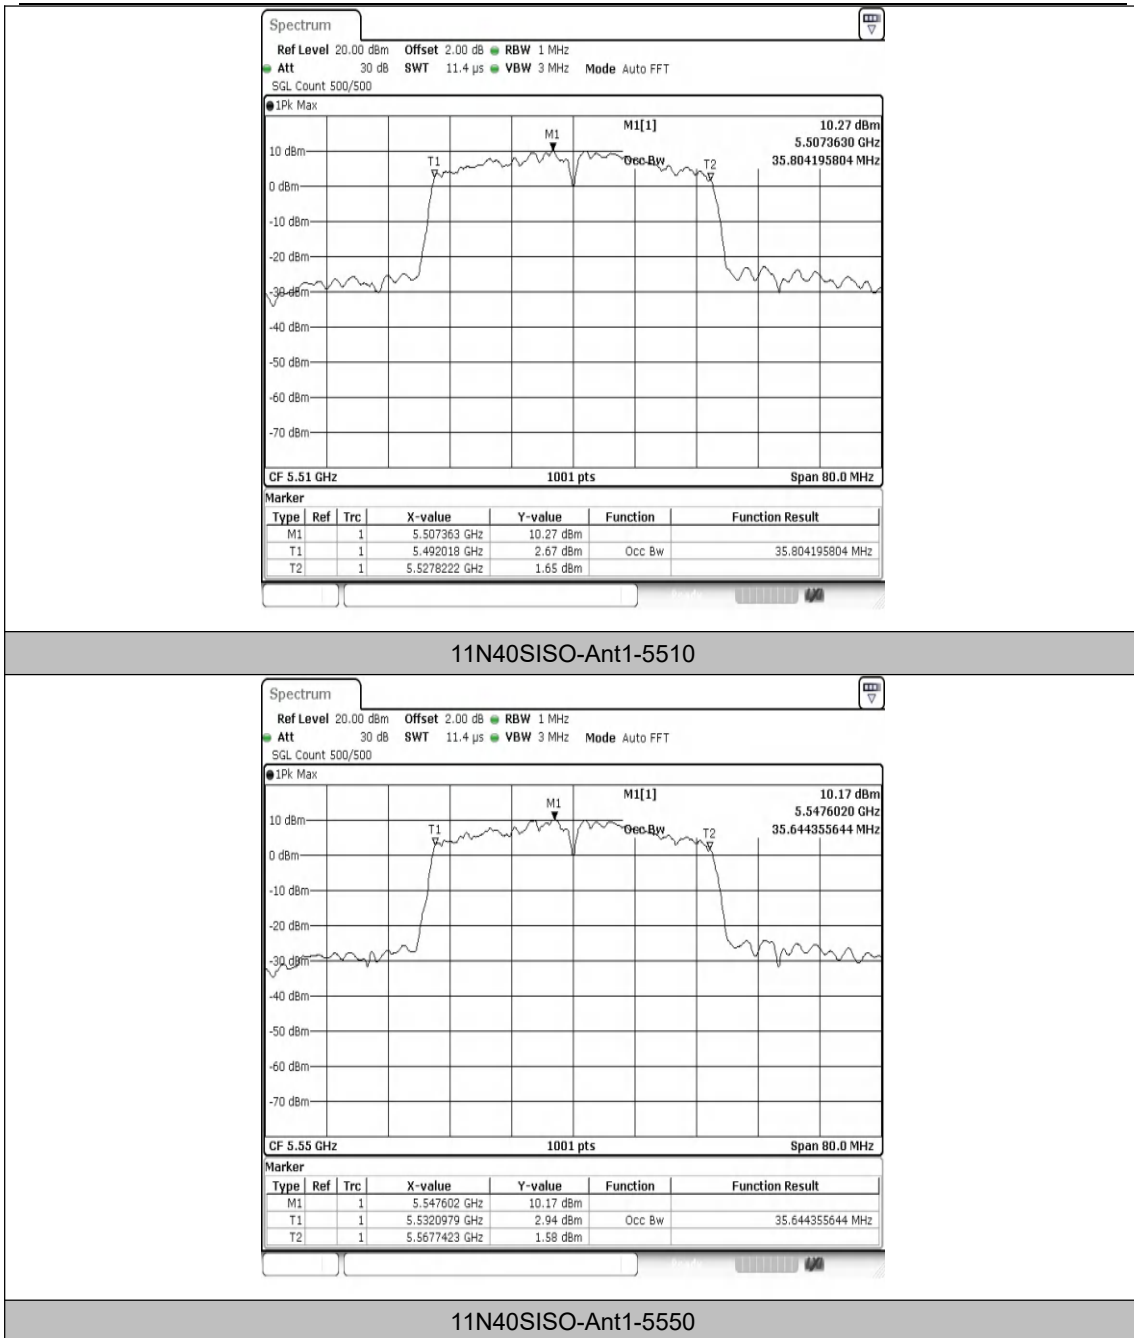

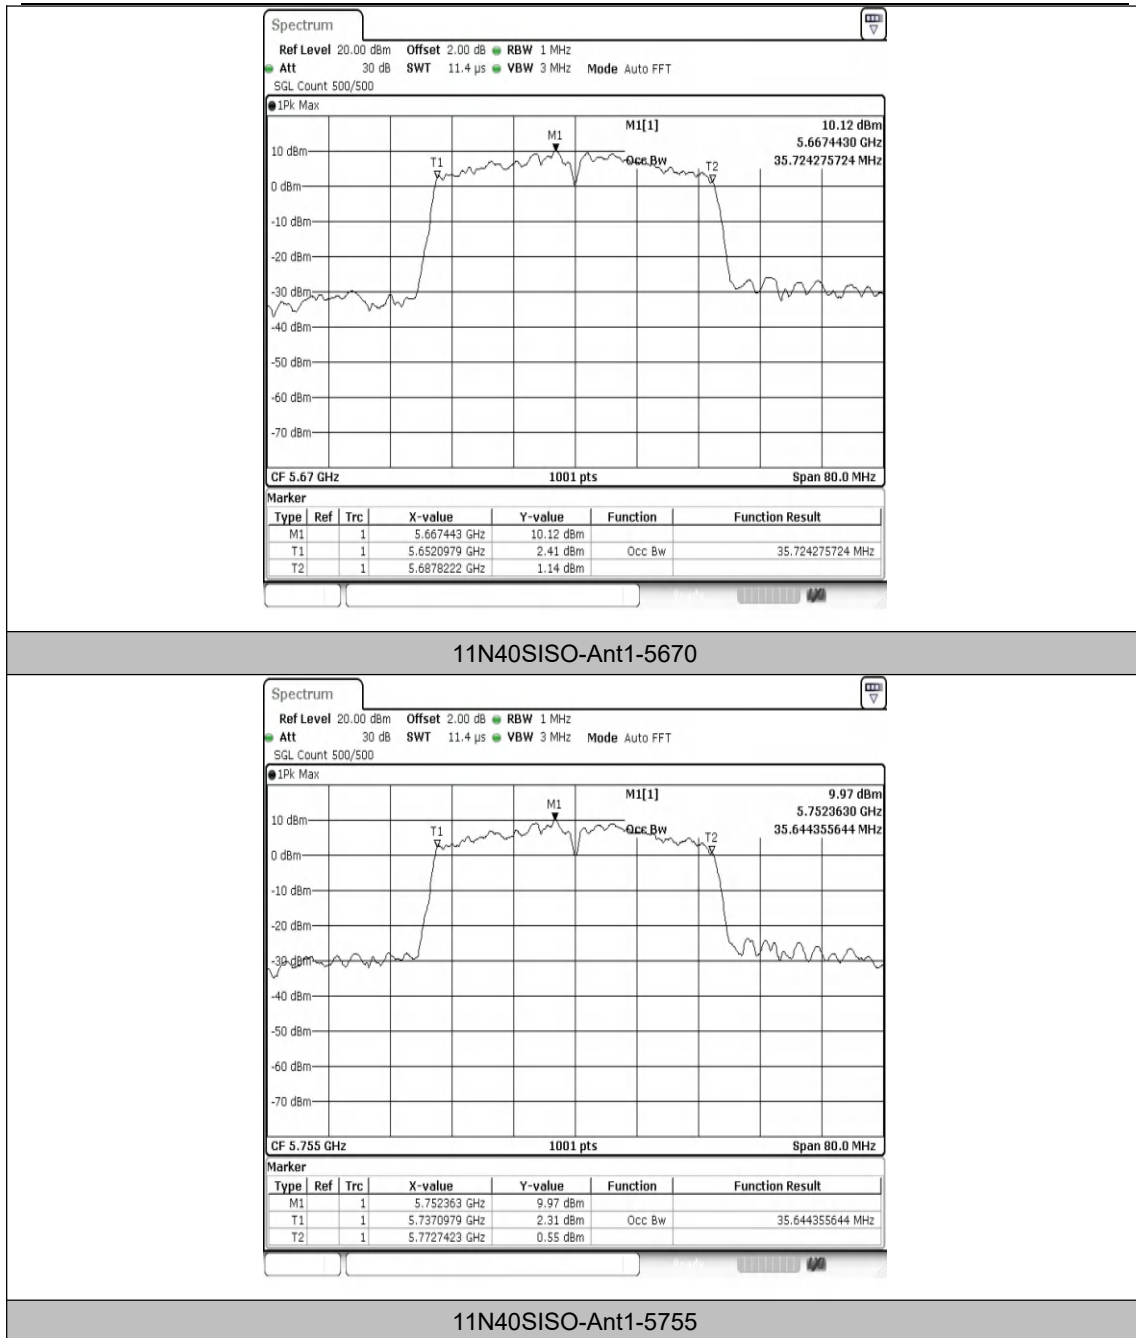


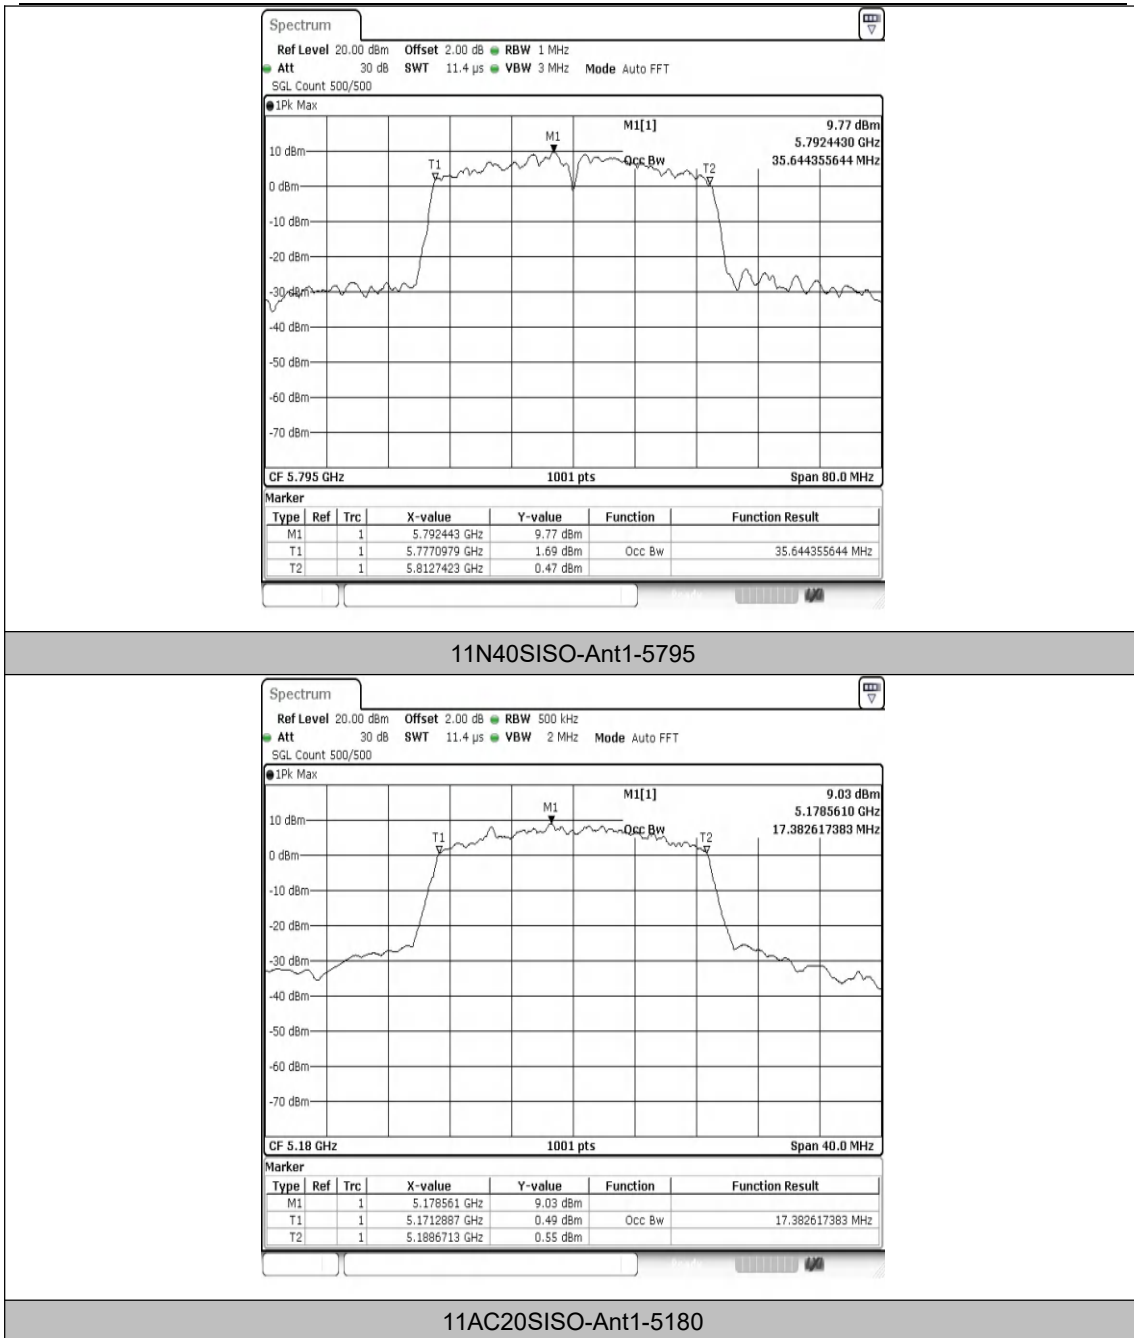


### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

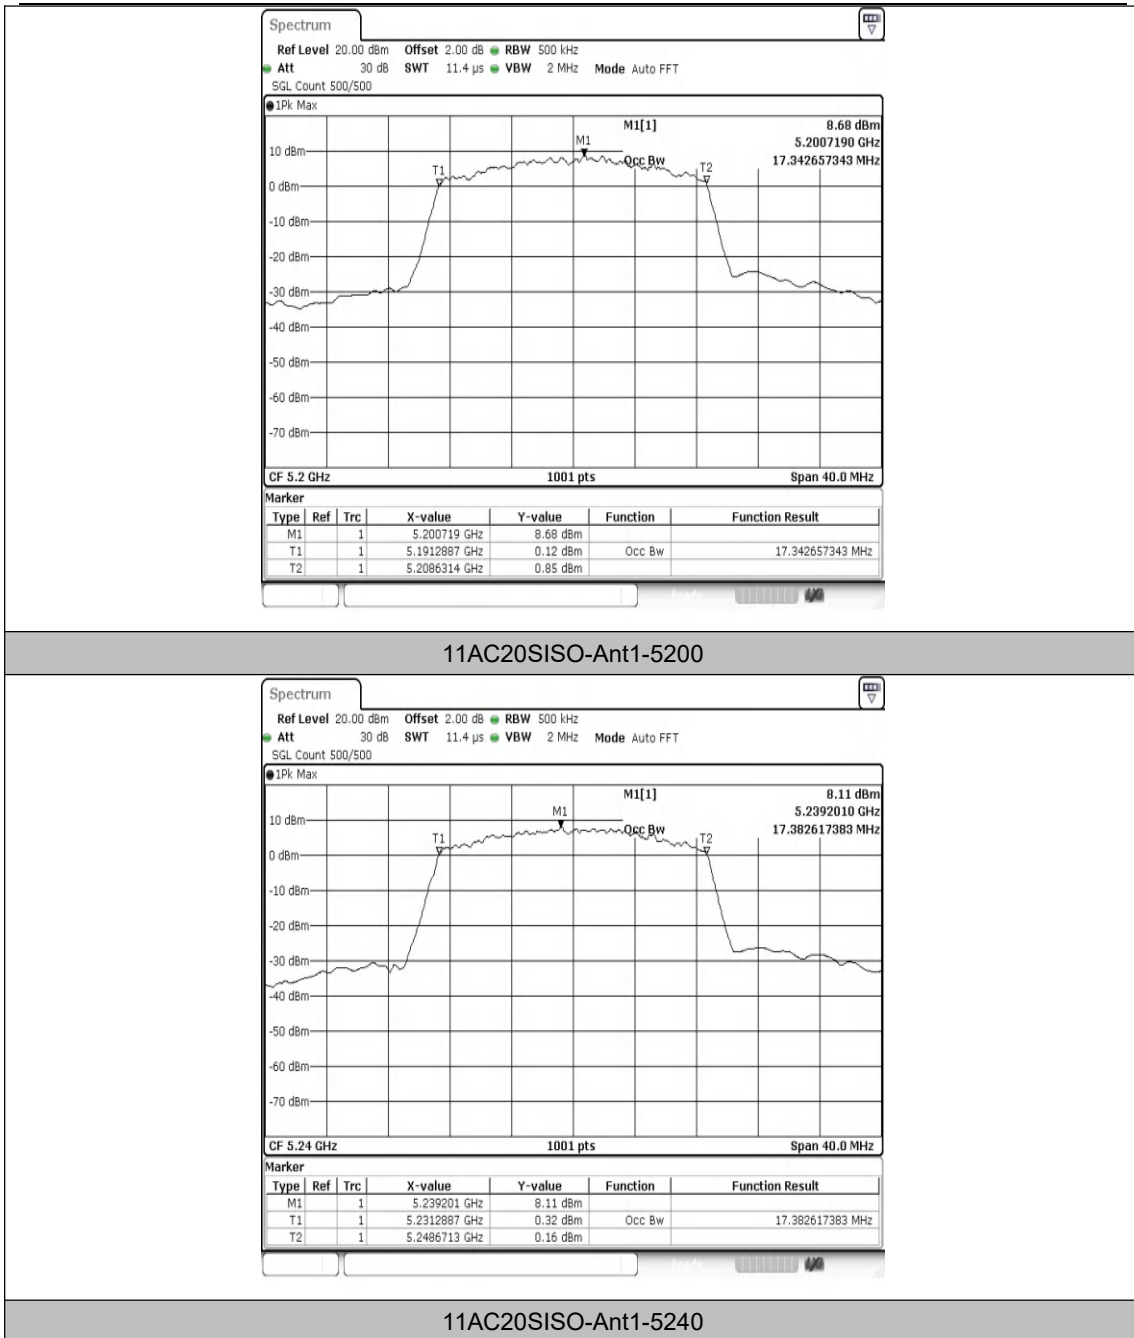


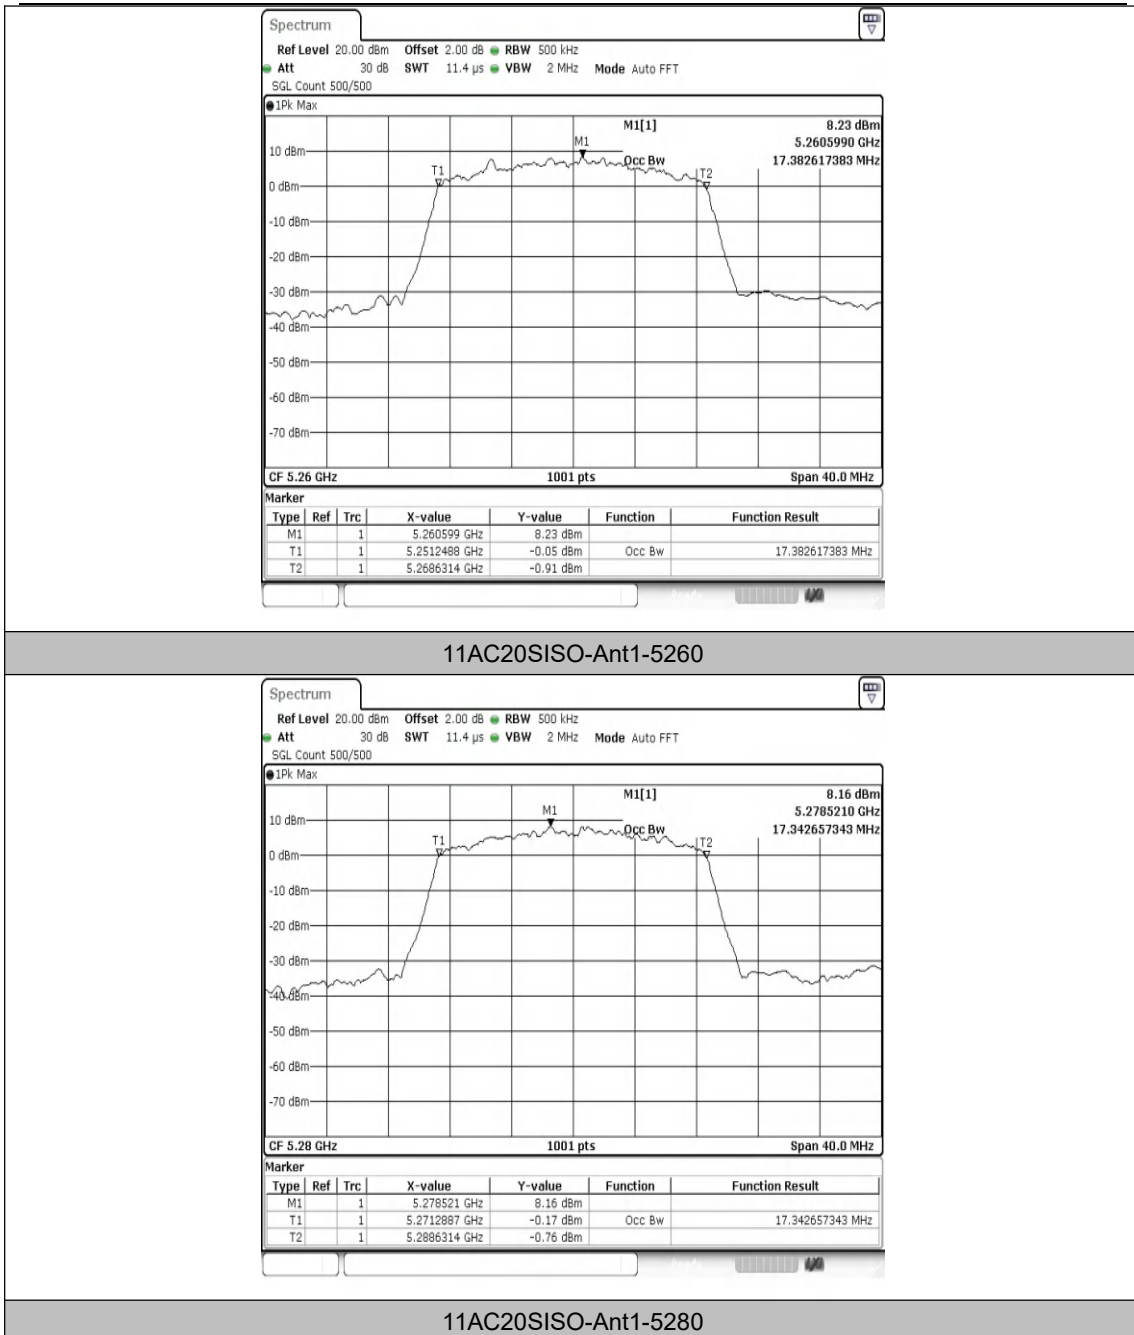

**Shenzhen Anbotek Compliance Laboratory Limited**

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

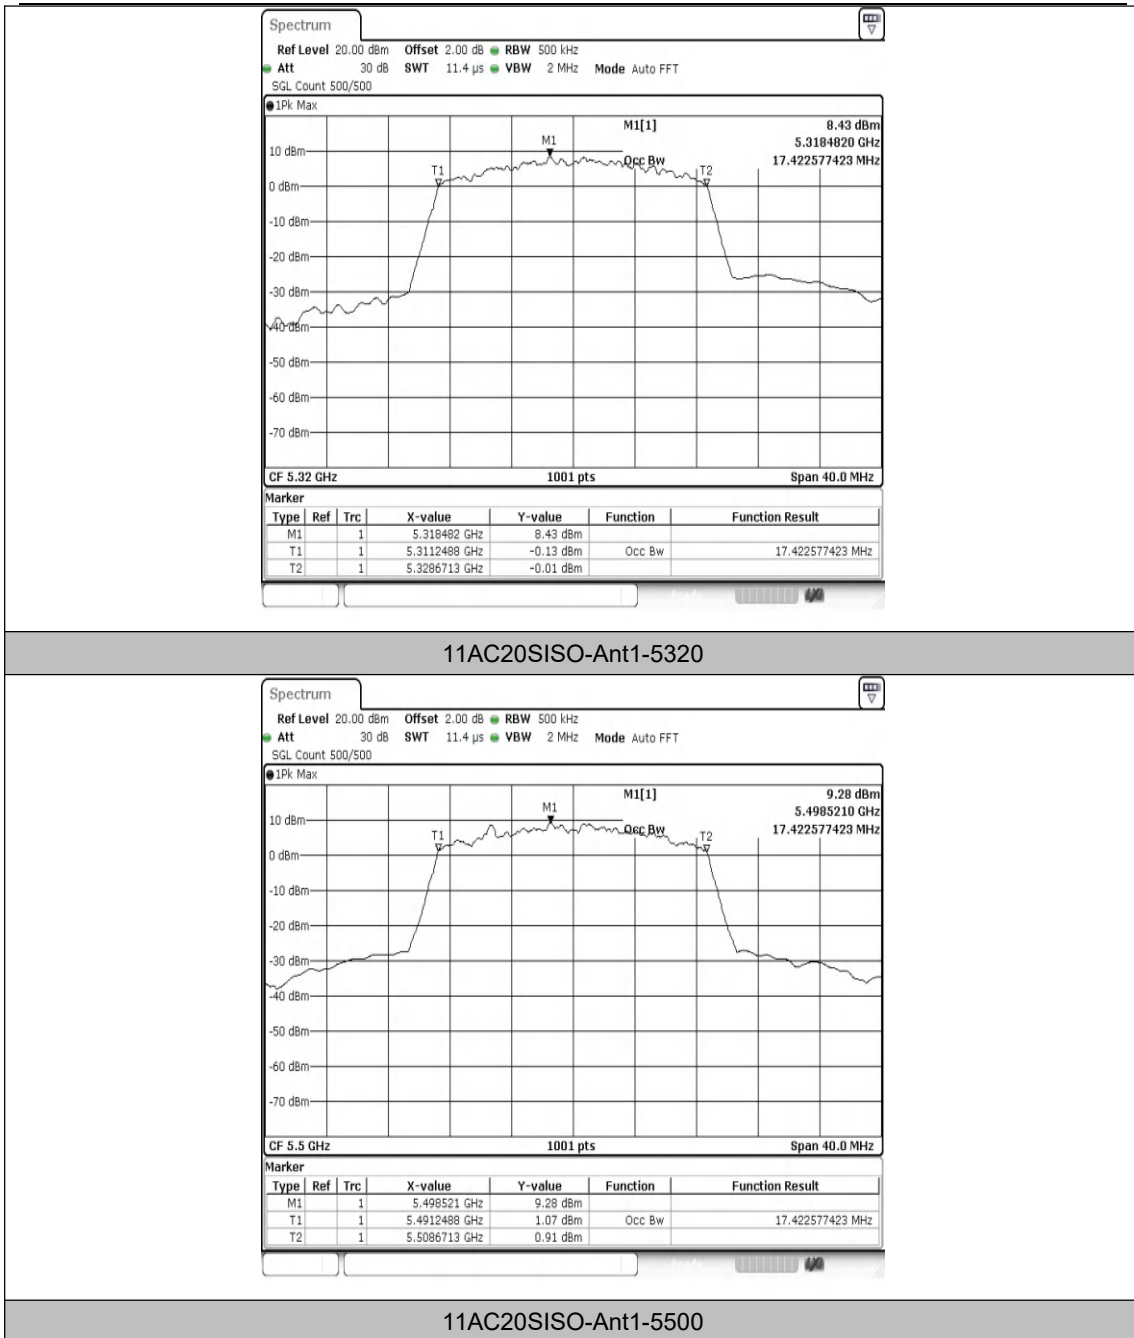

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

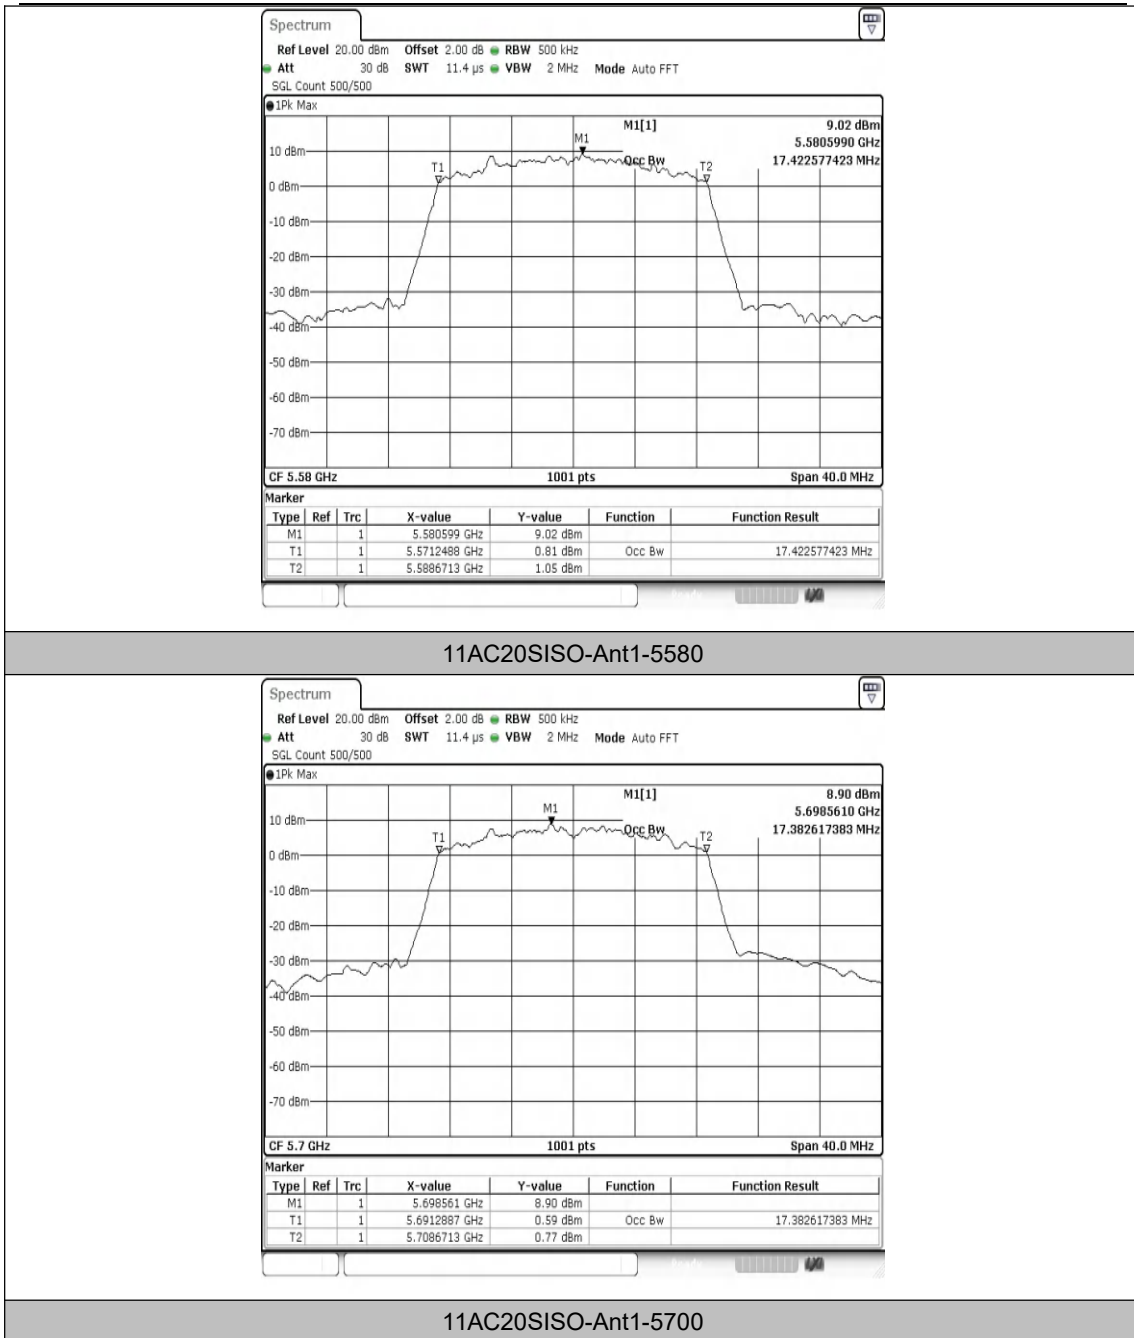


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)




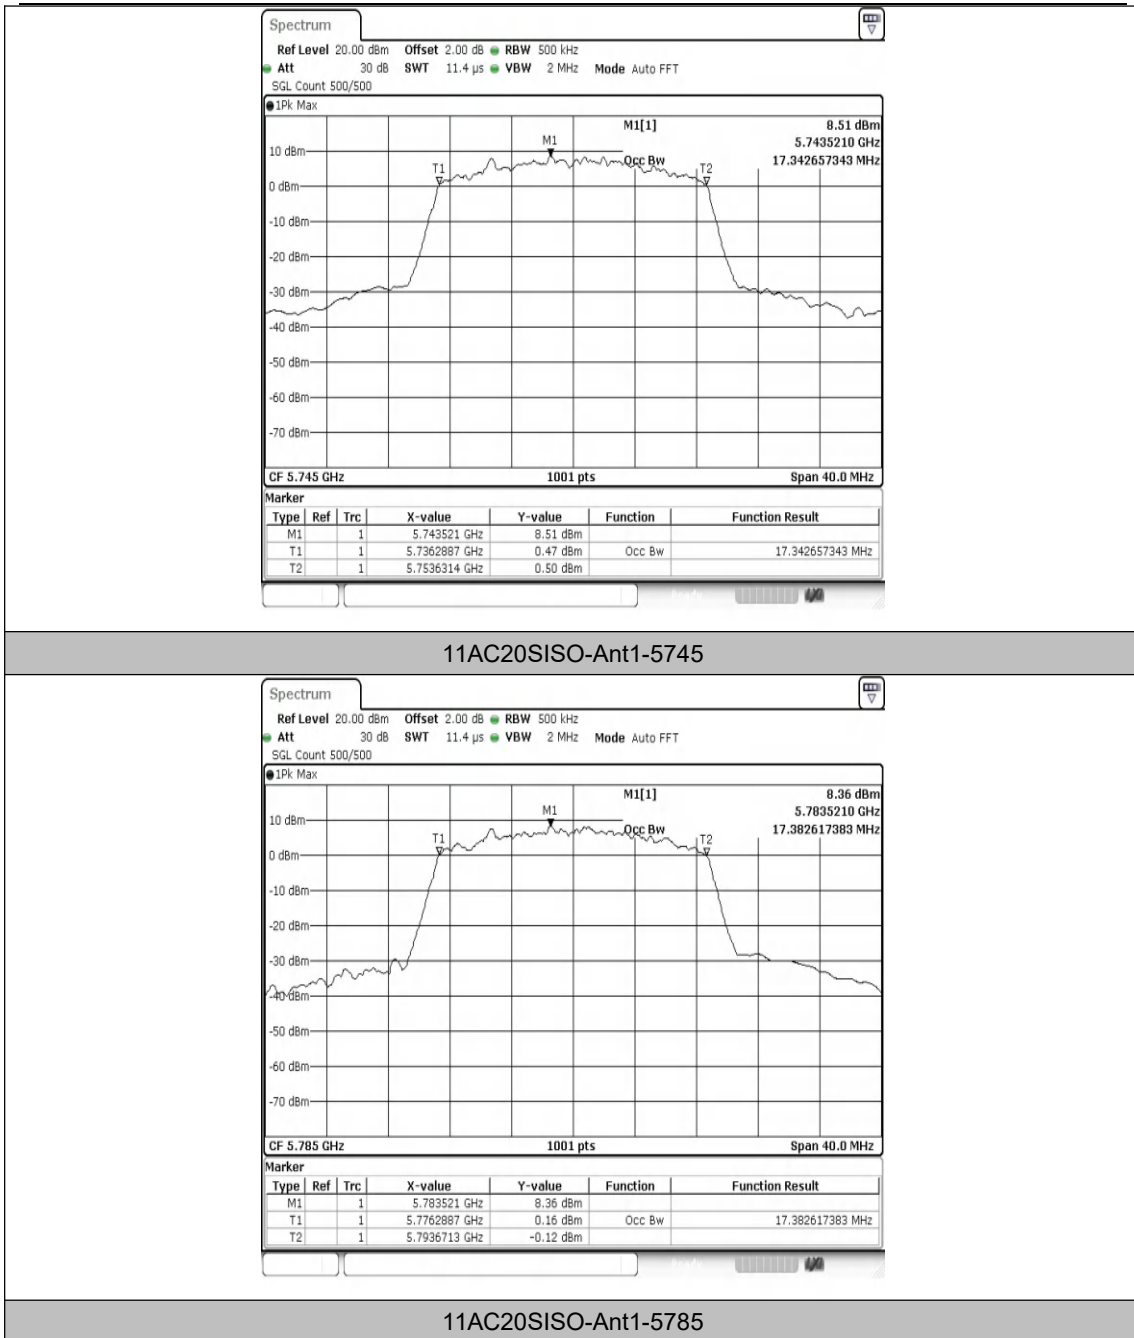


**Shenzhen Anbotek Compliance Laboratory Limited**


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

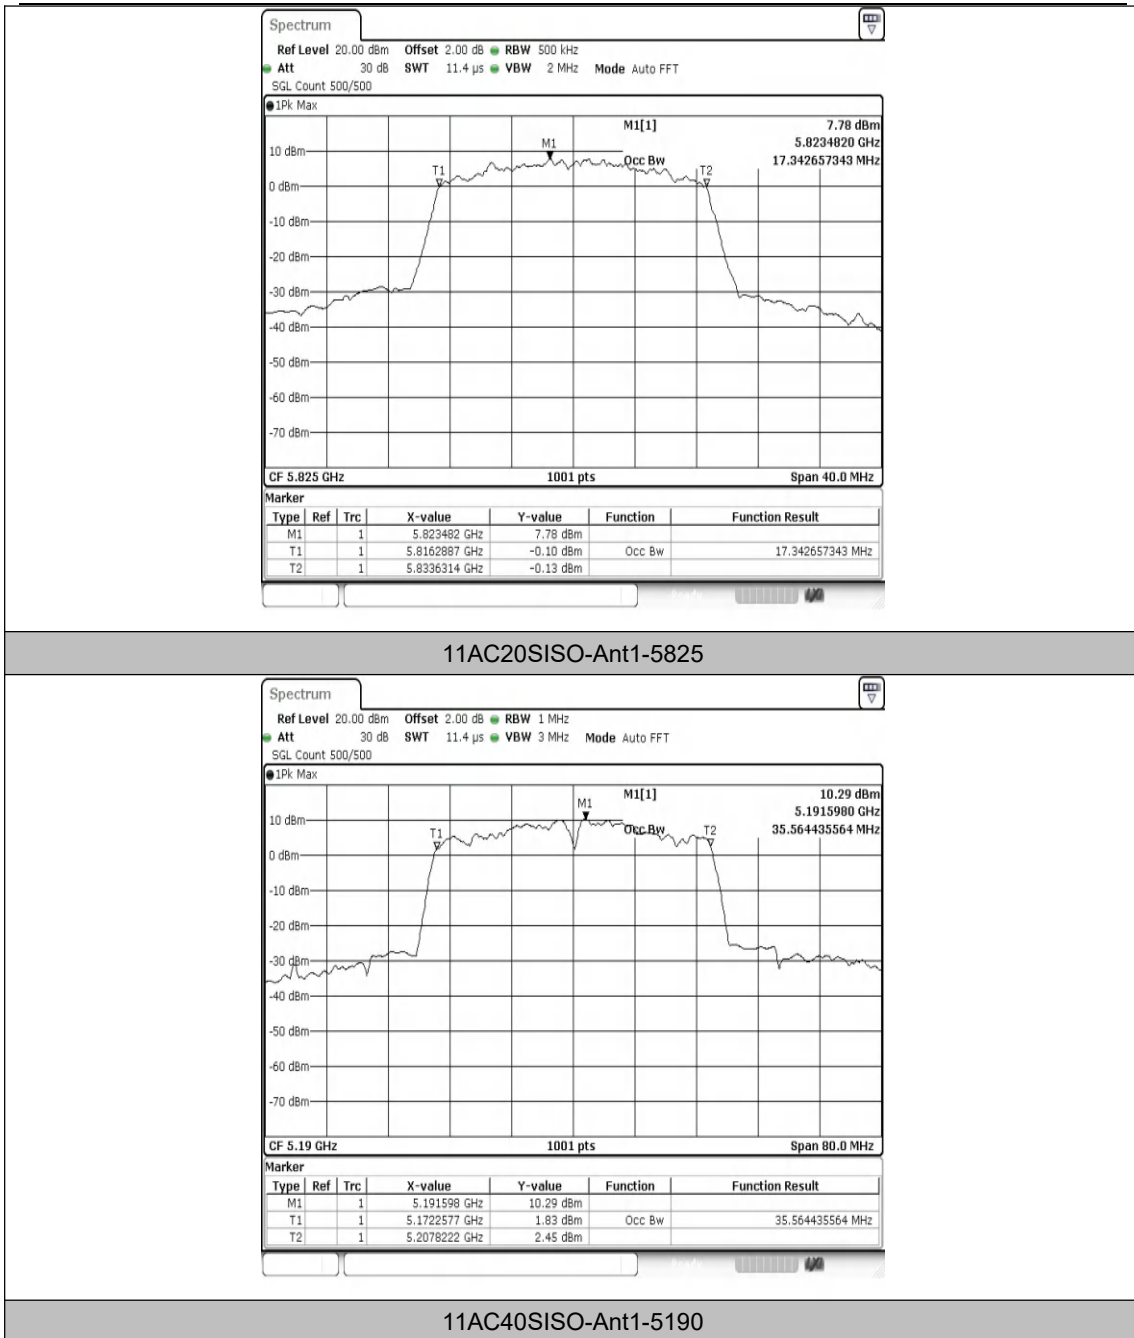


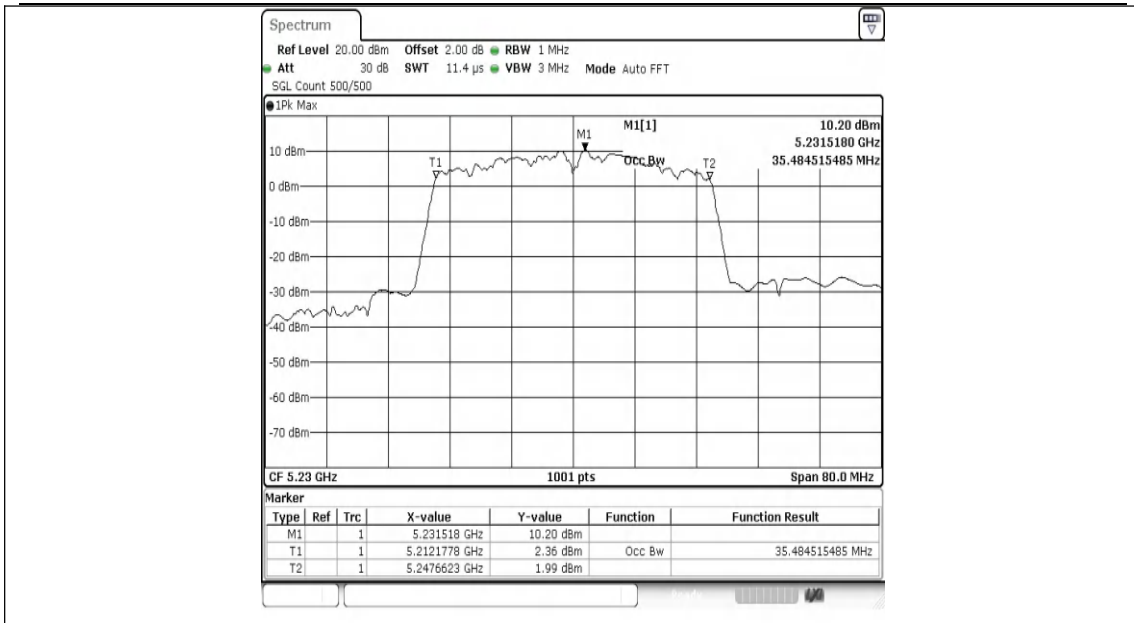



11AC40SISO-Ant1-5230

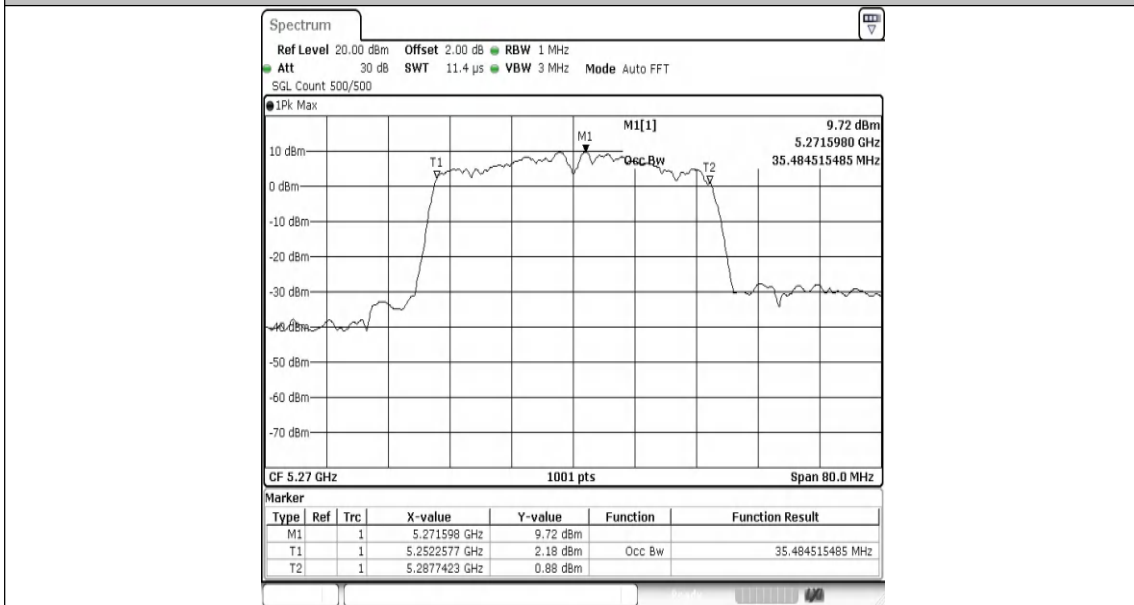

11AC40SISO-Ant1-5270

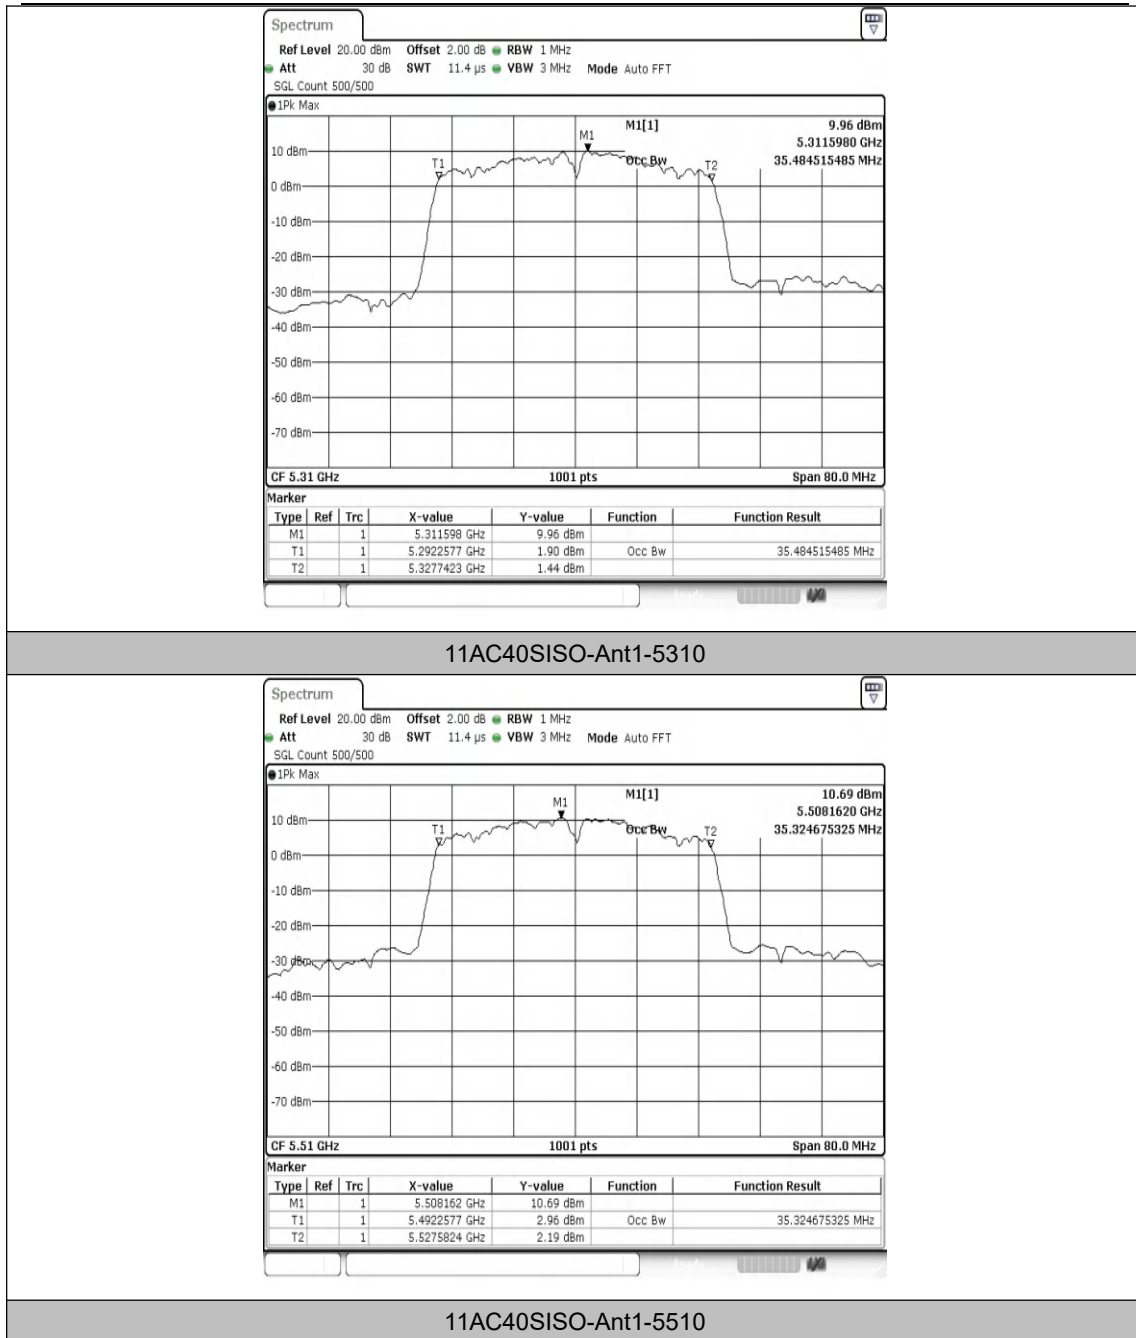

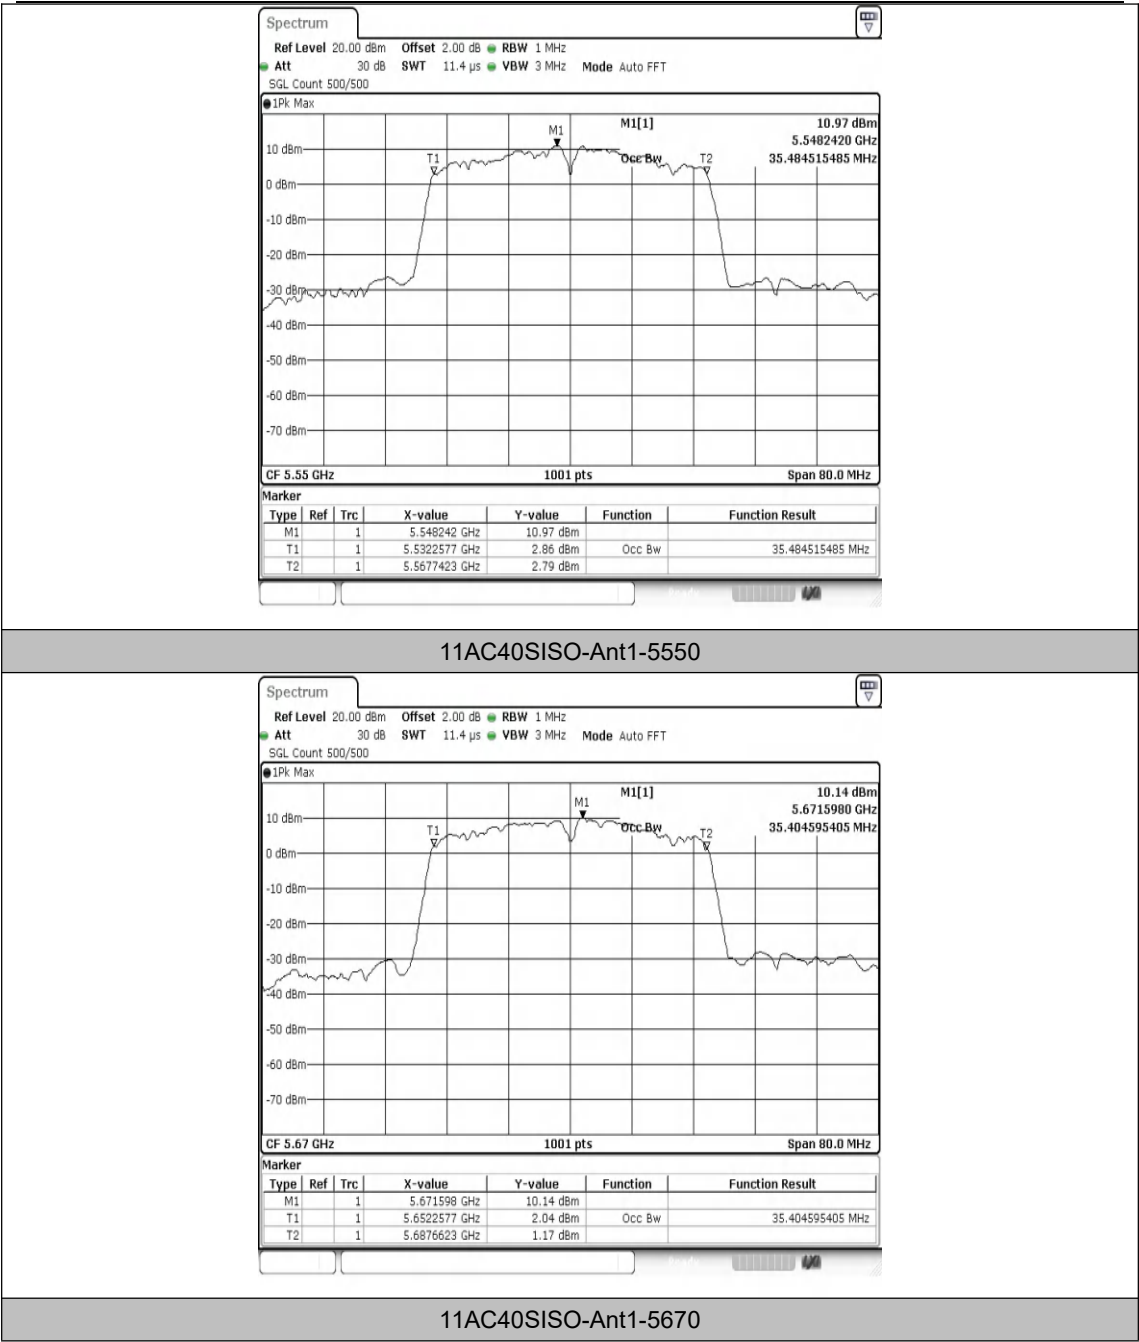


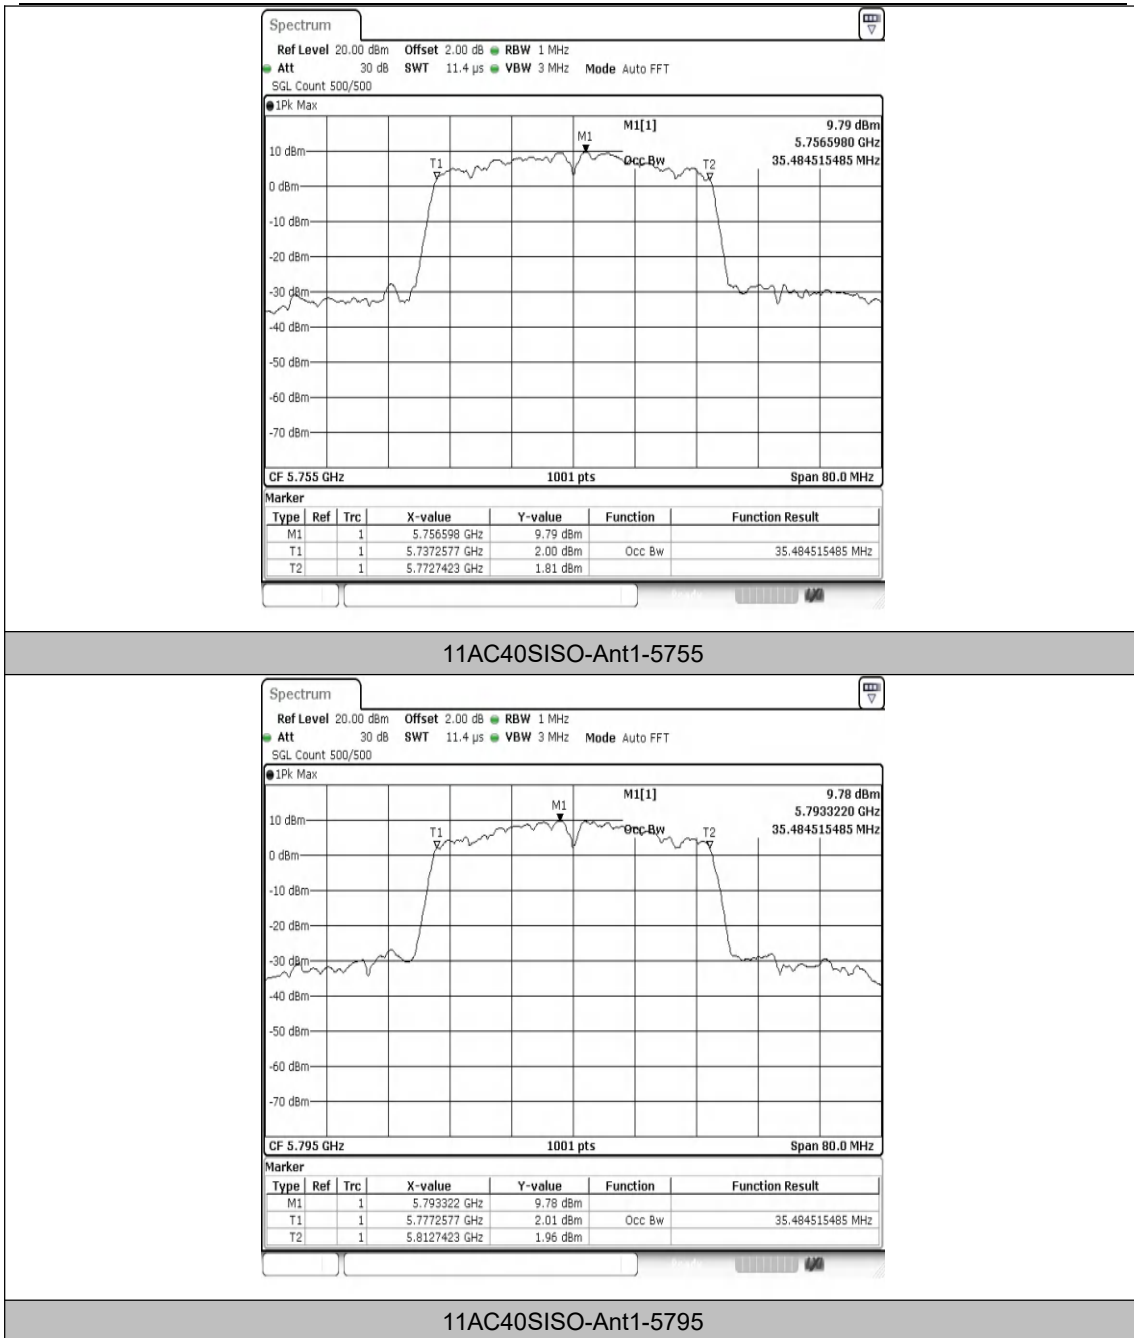


### Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

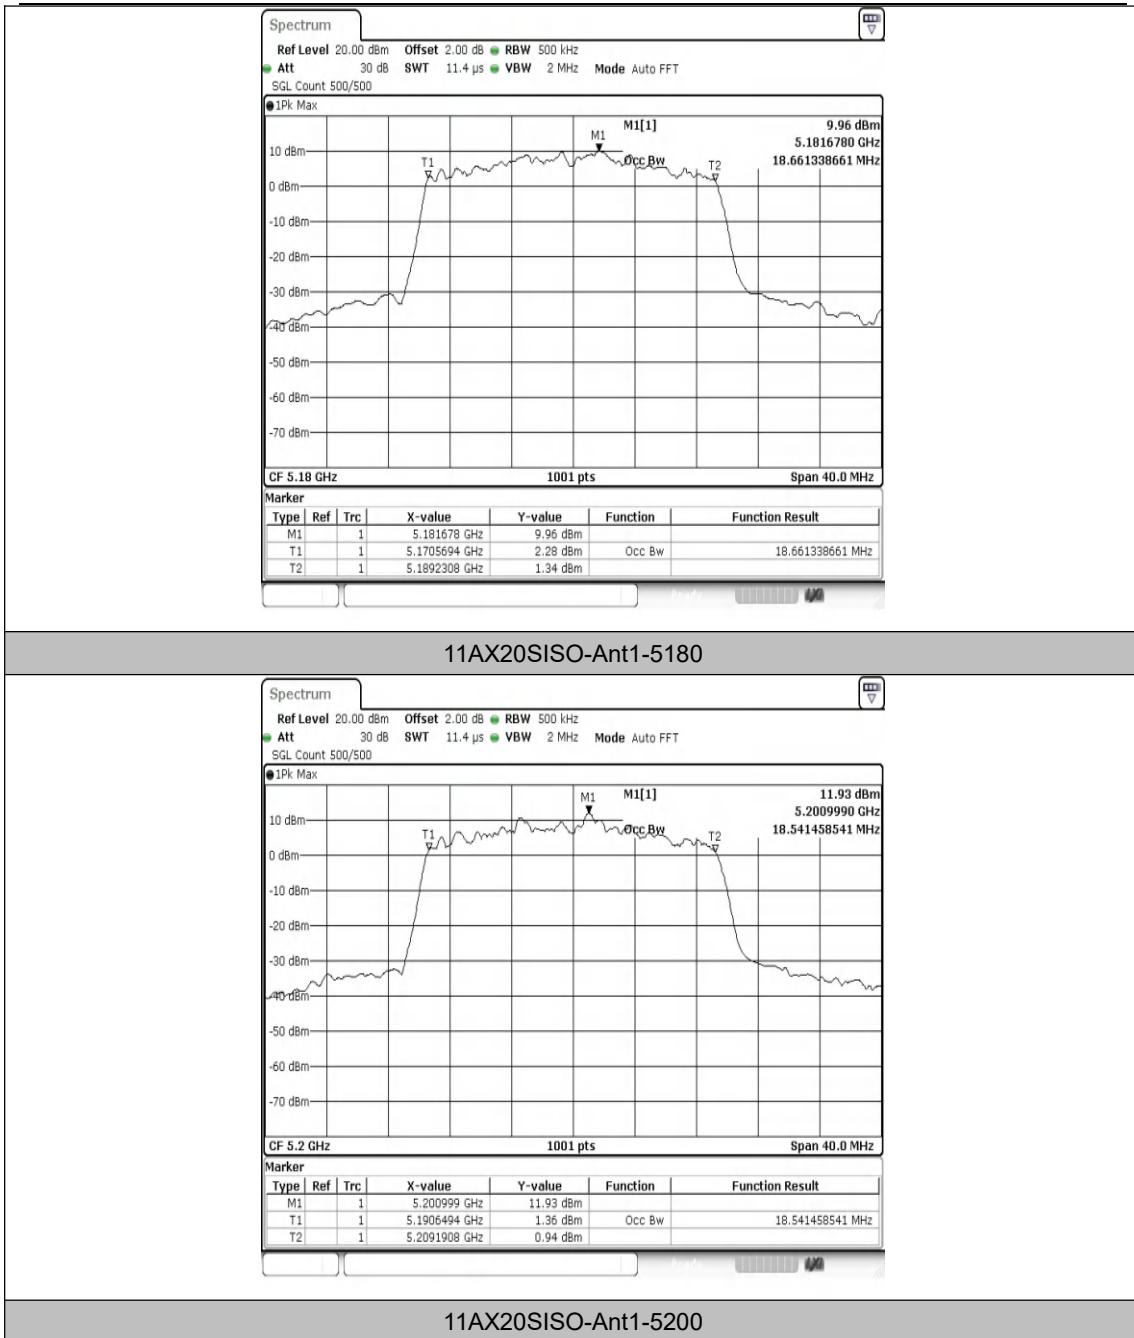



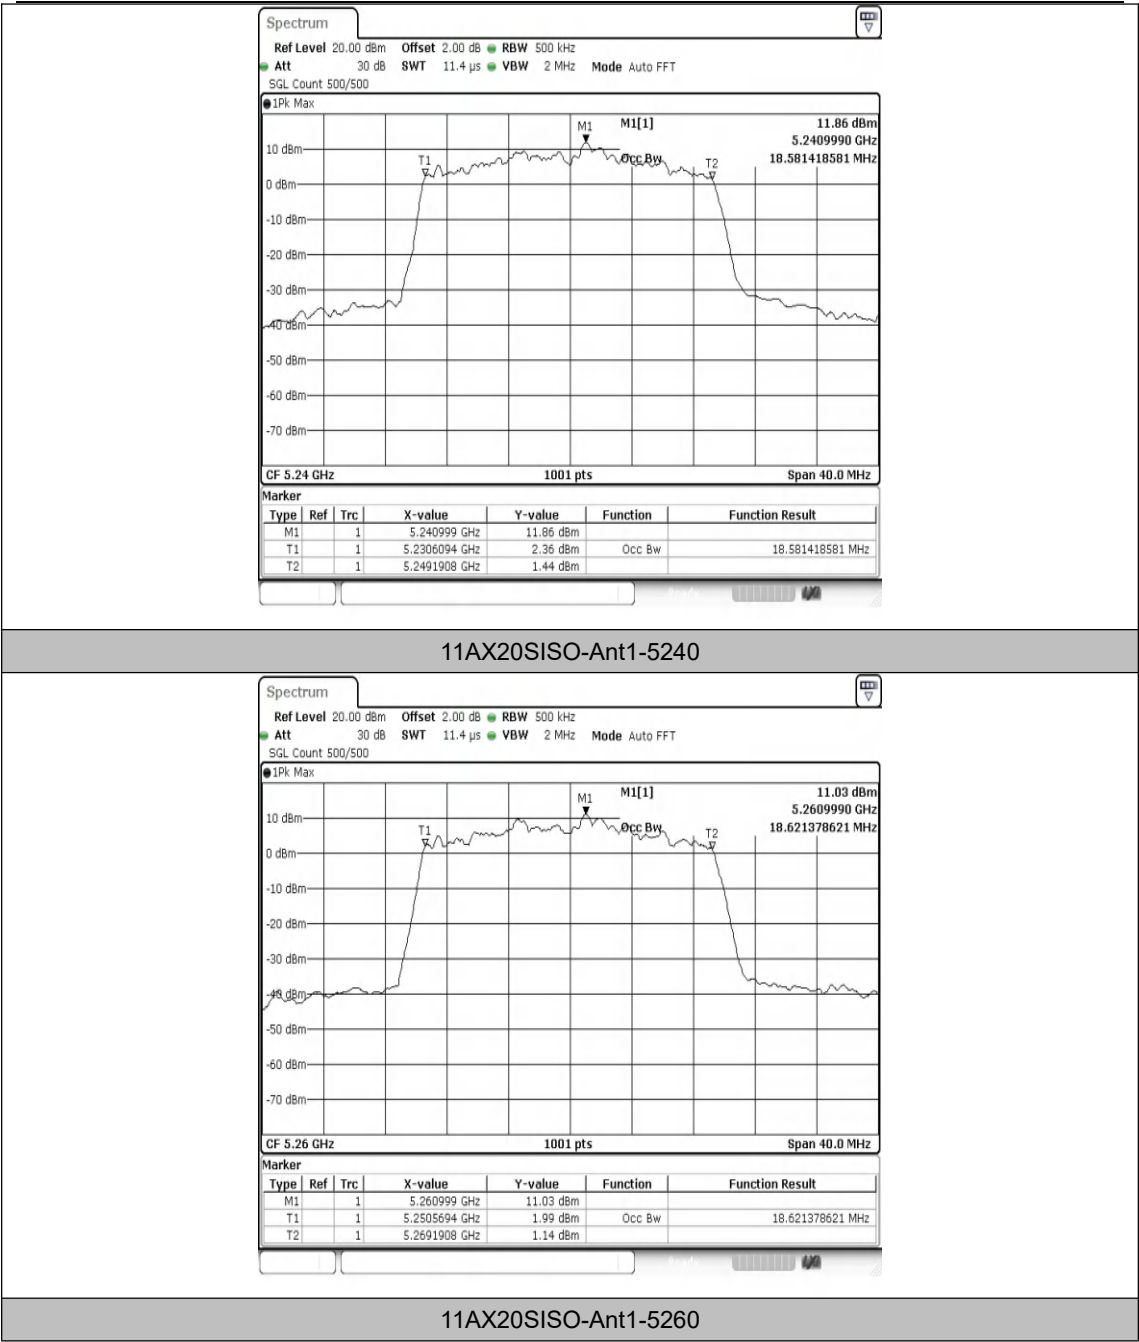


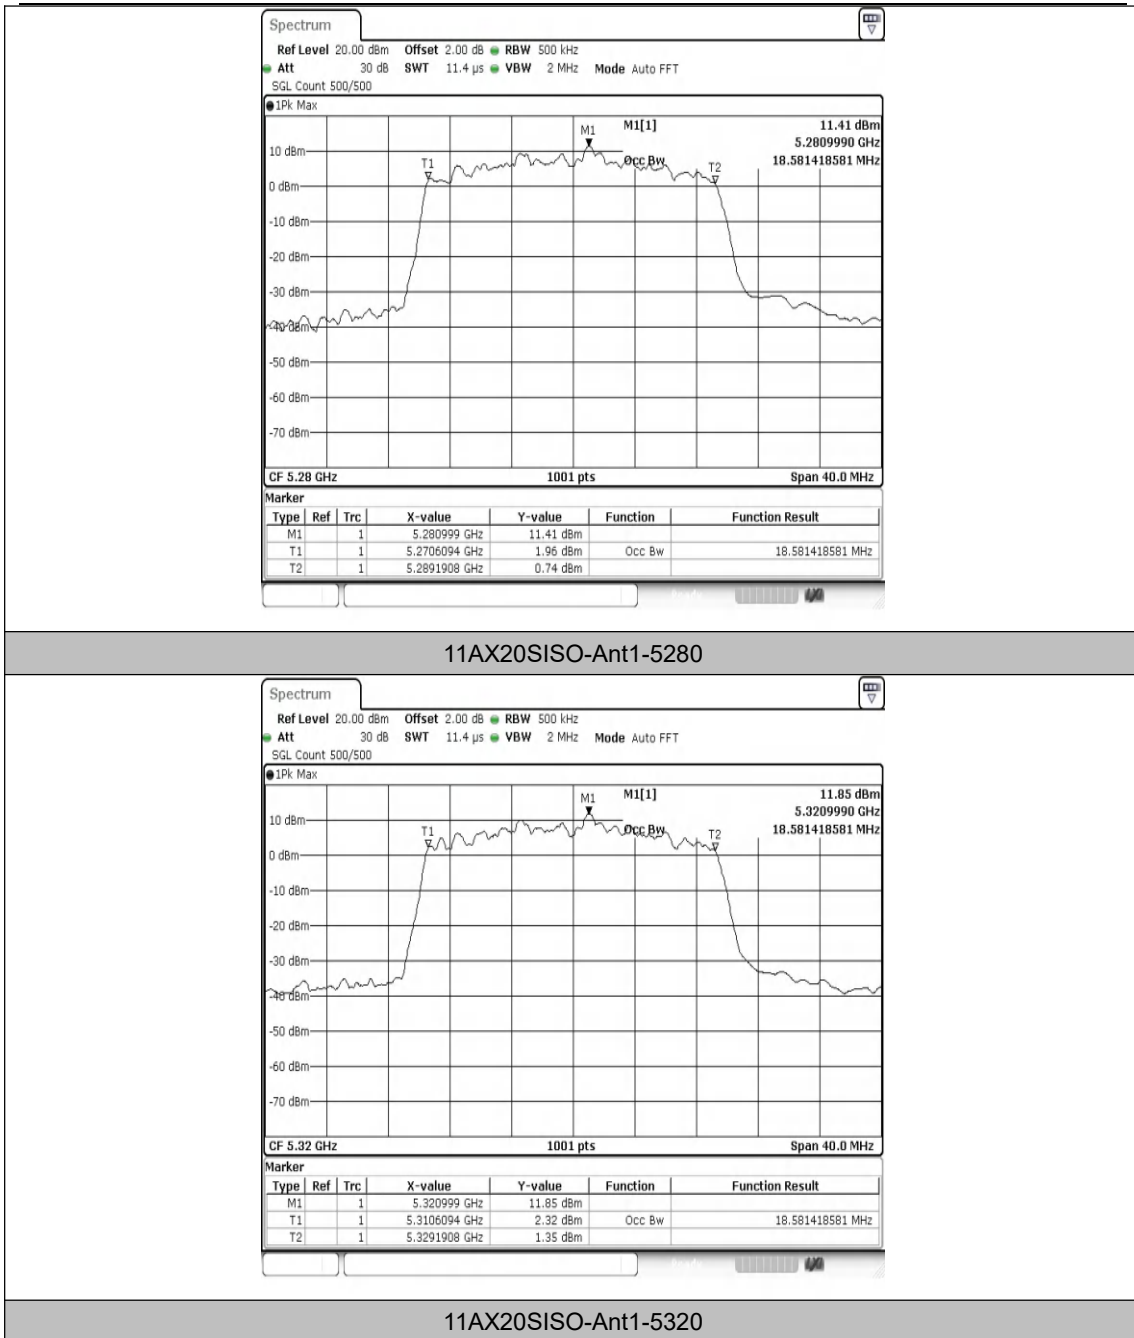

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

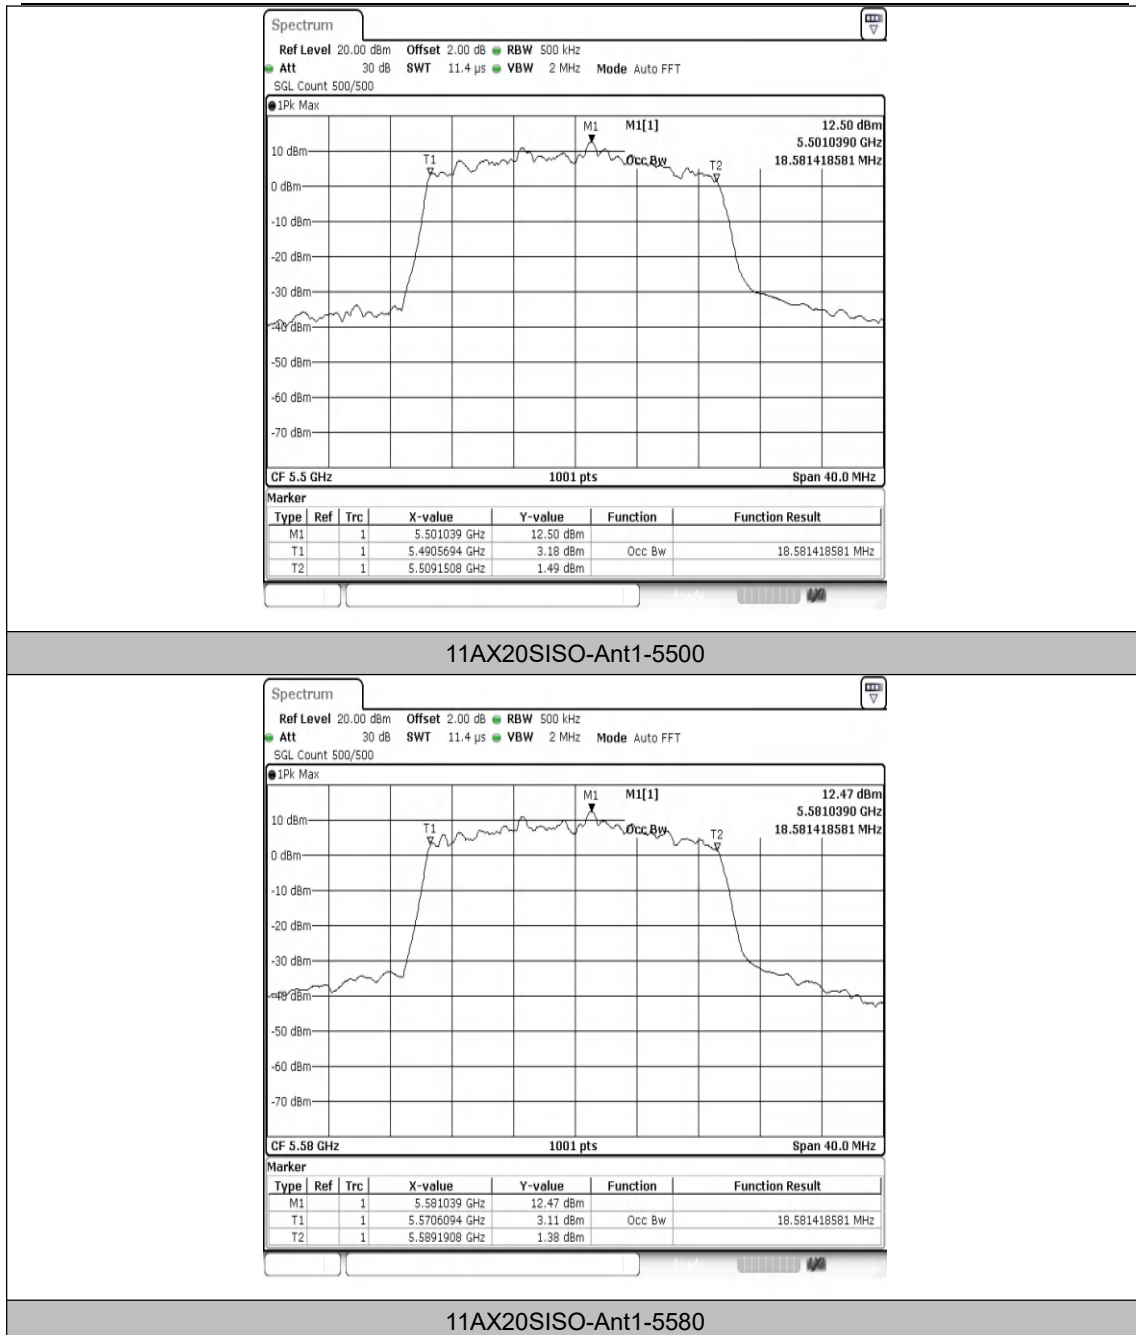

### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

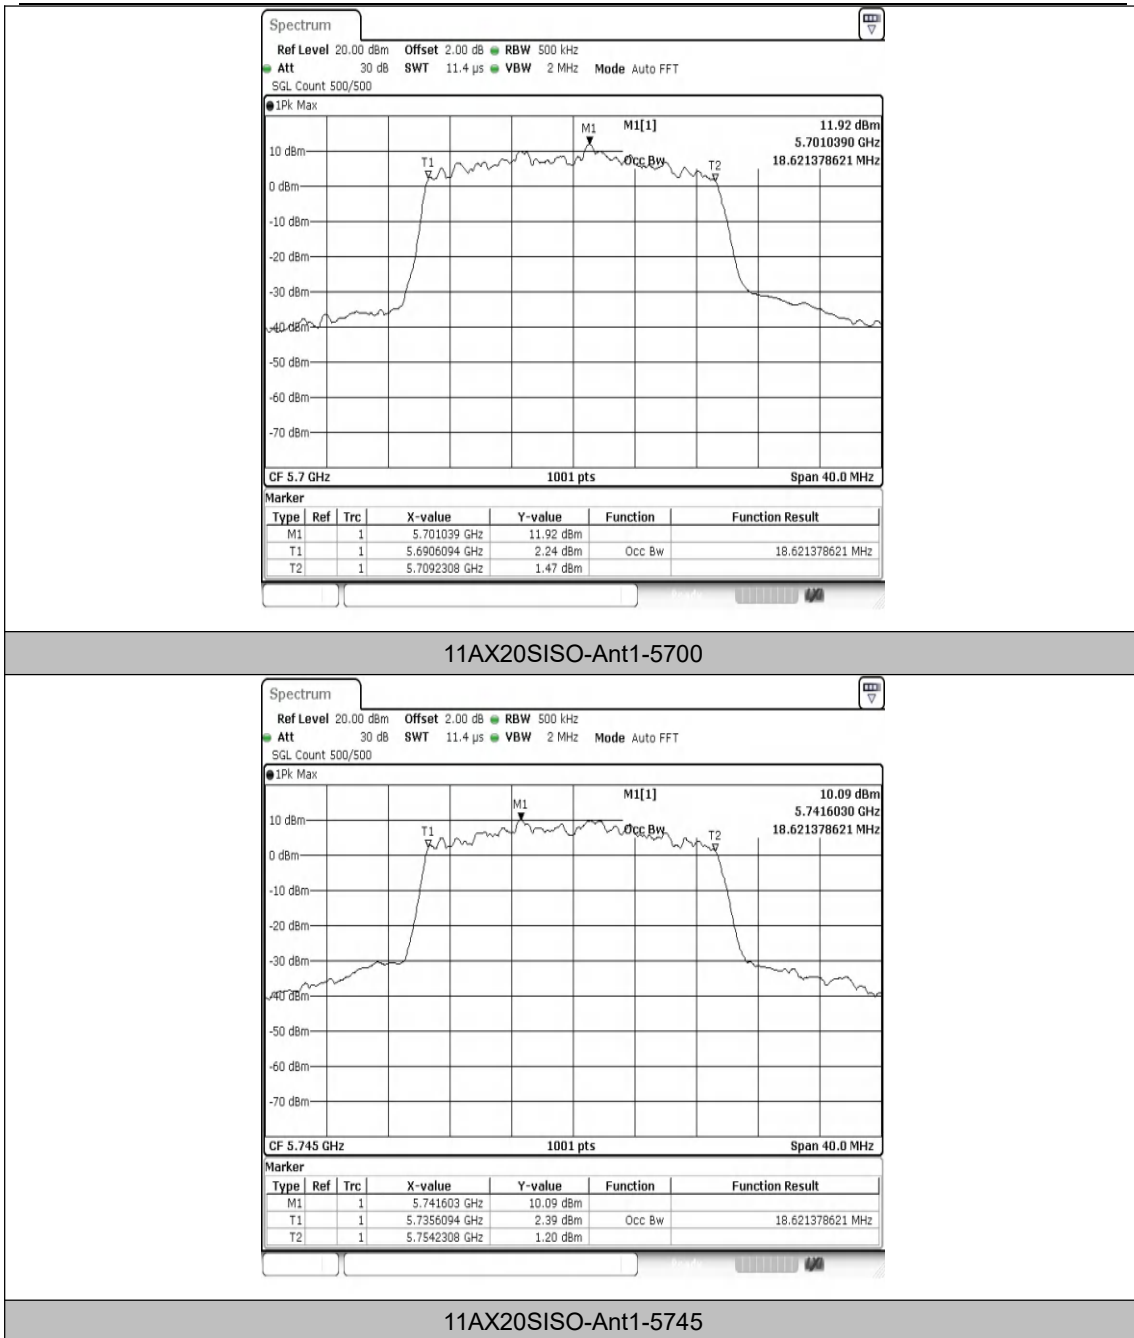

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

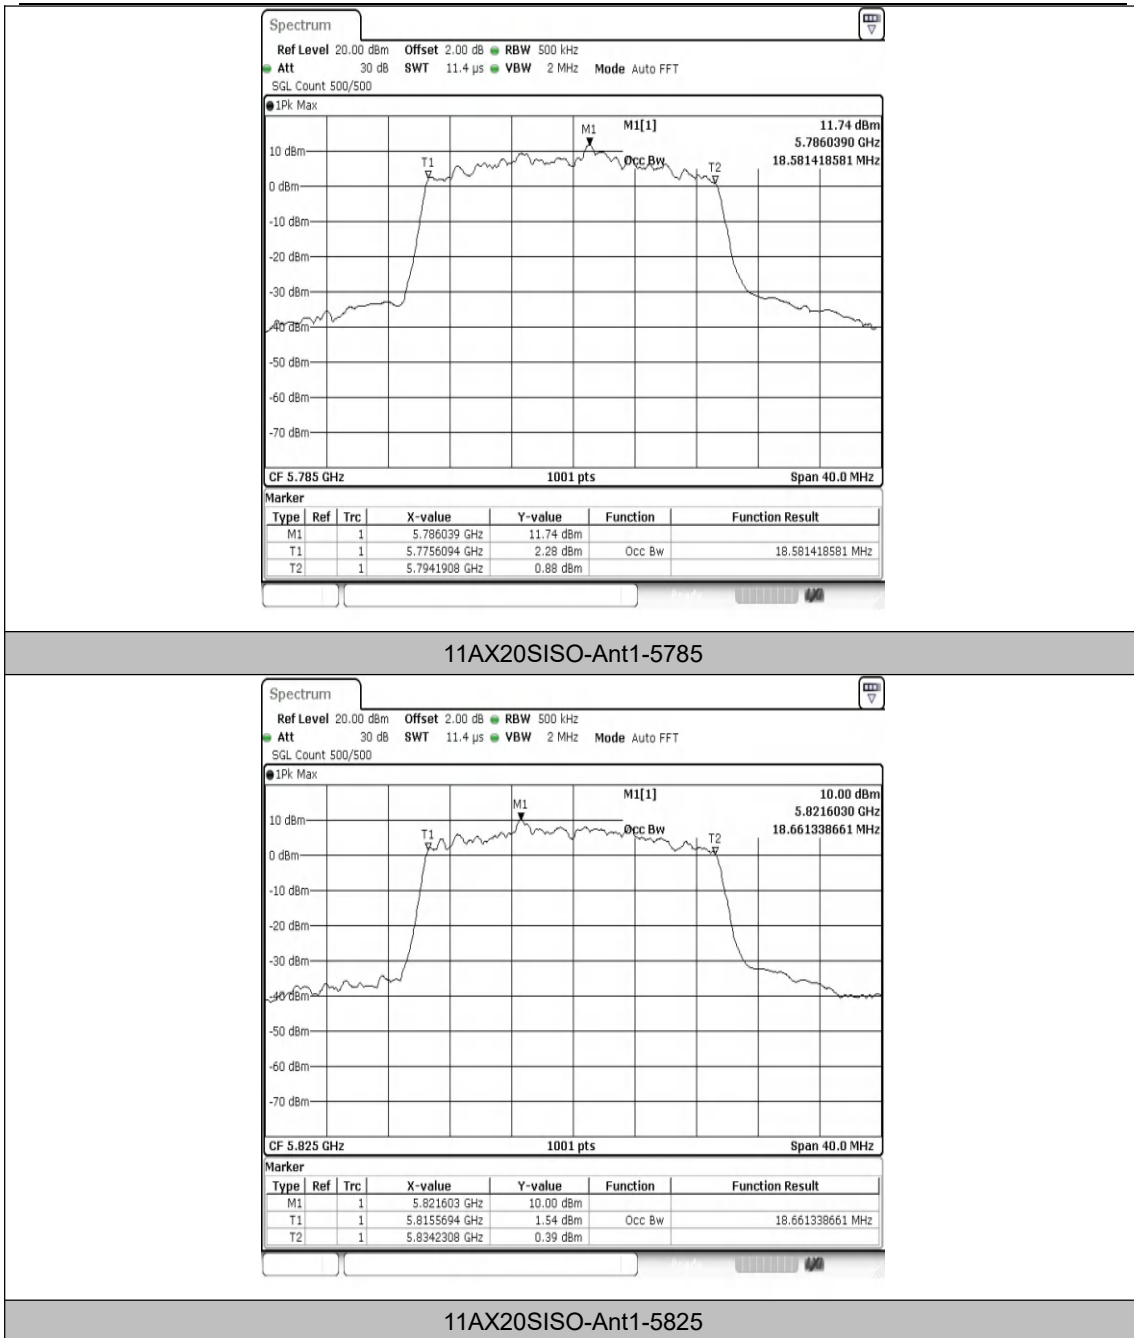

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

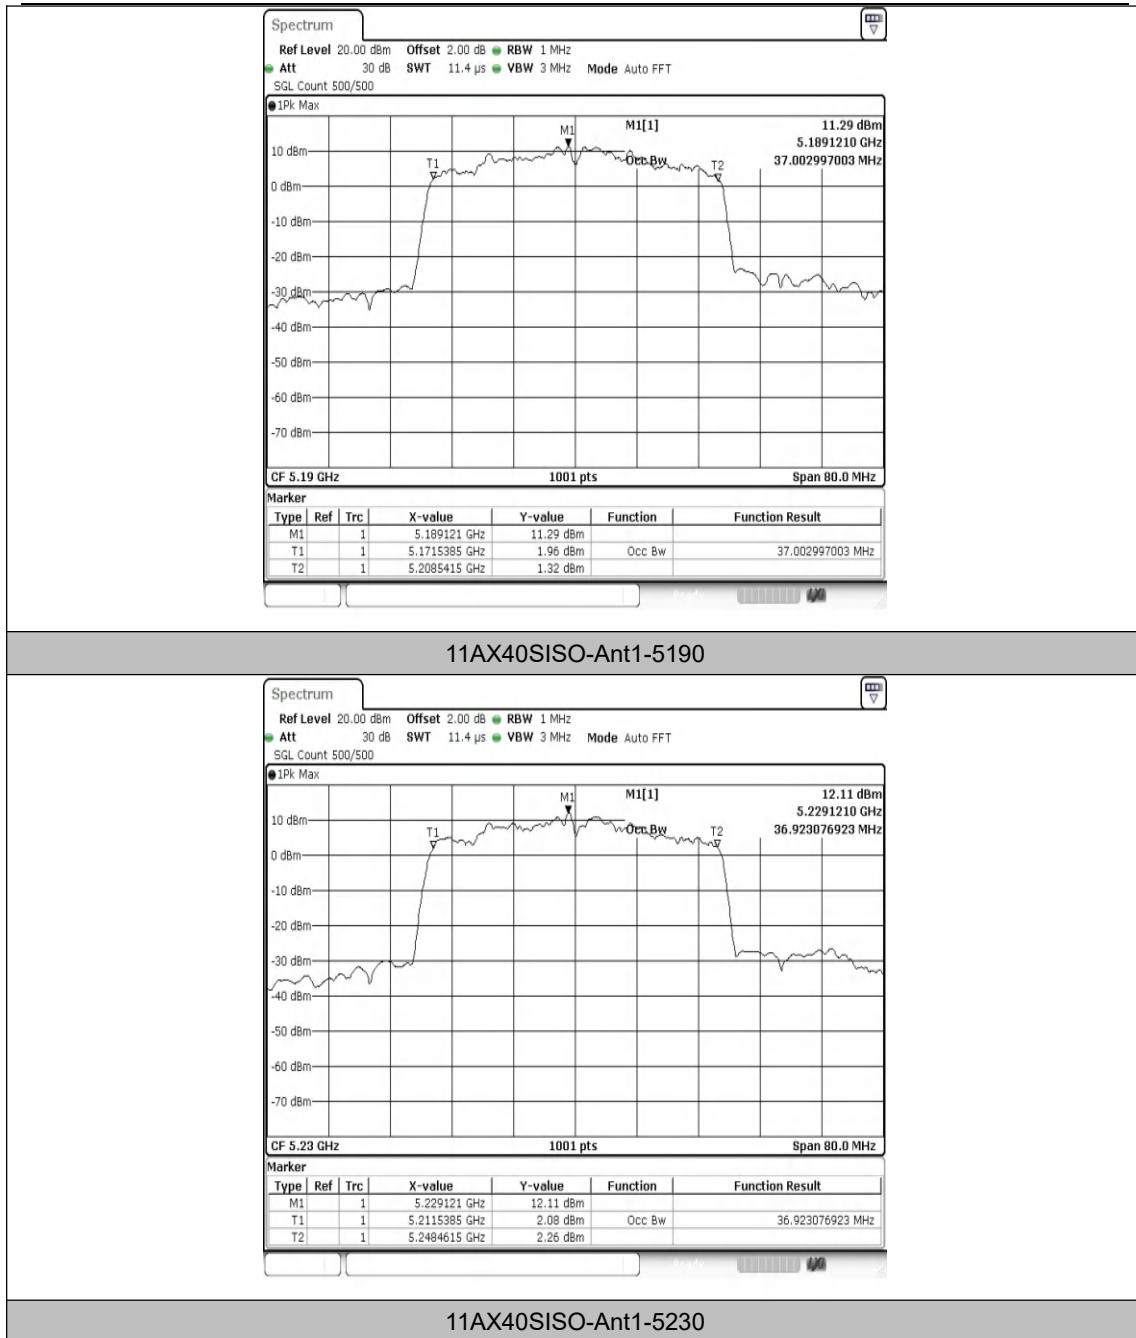


#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)

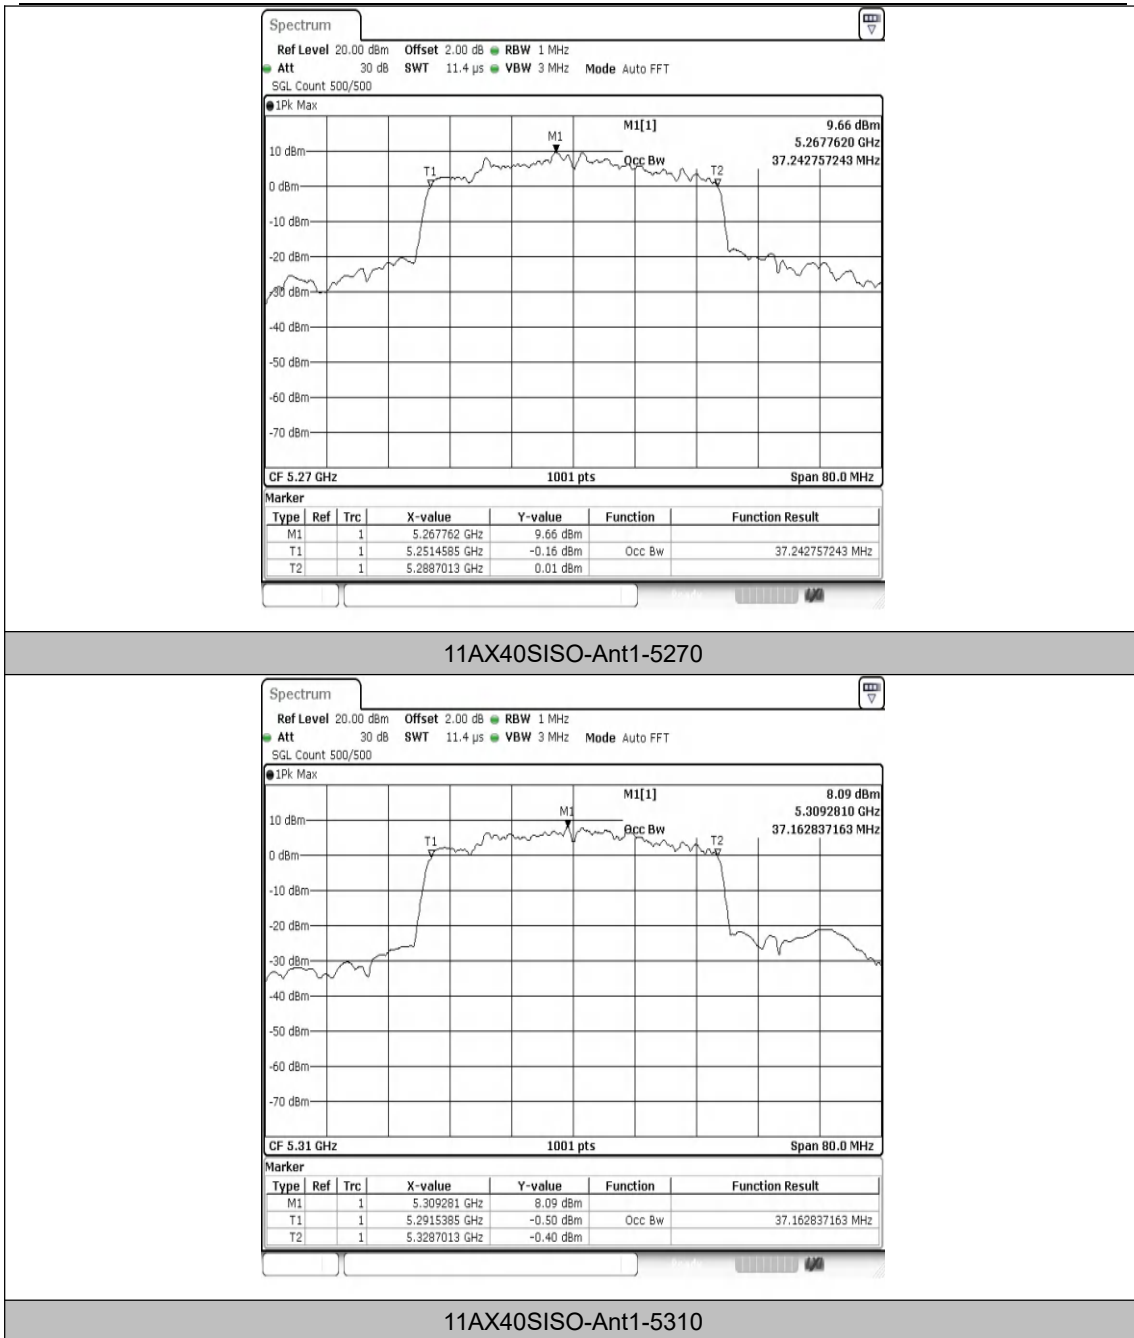



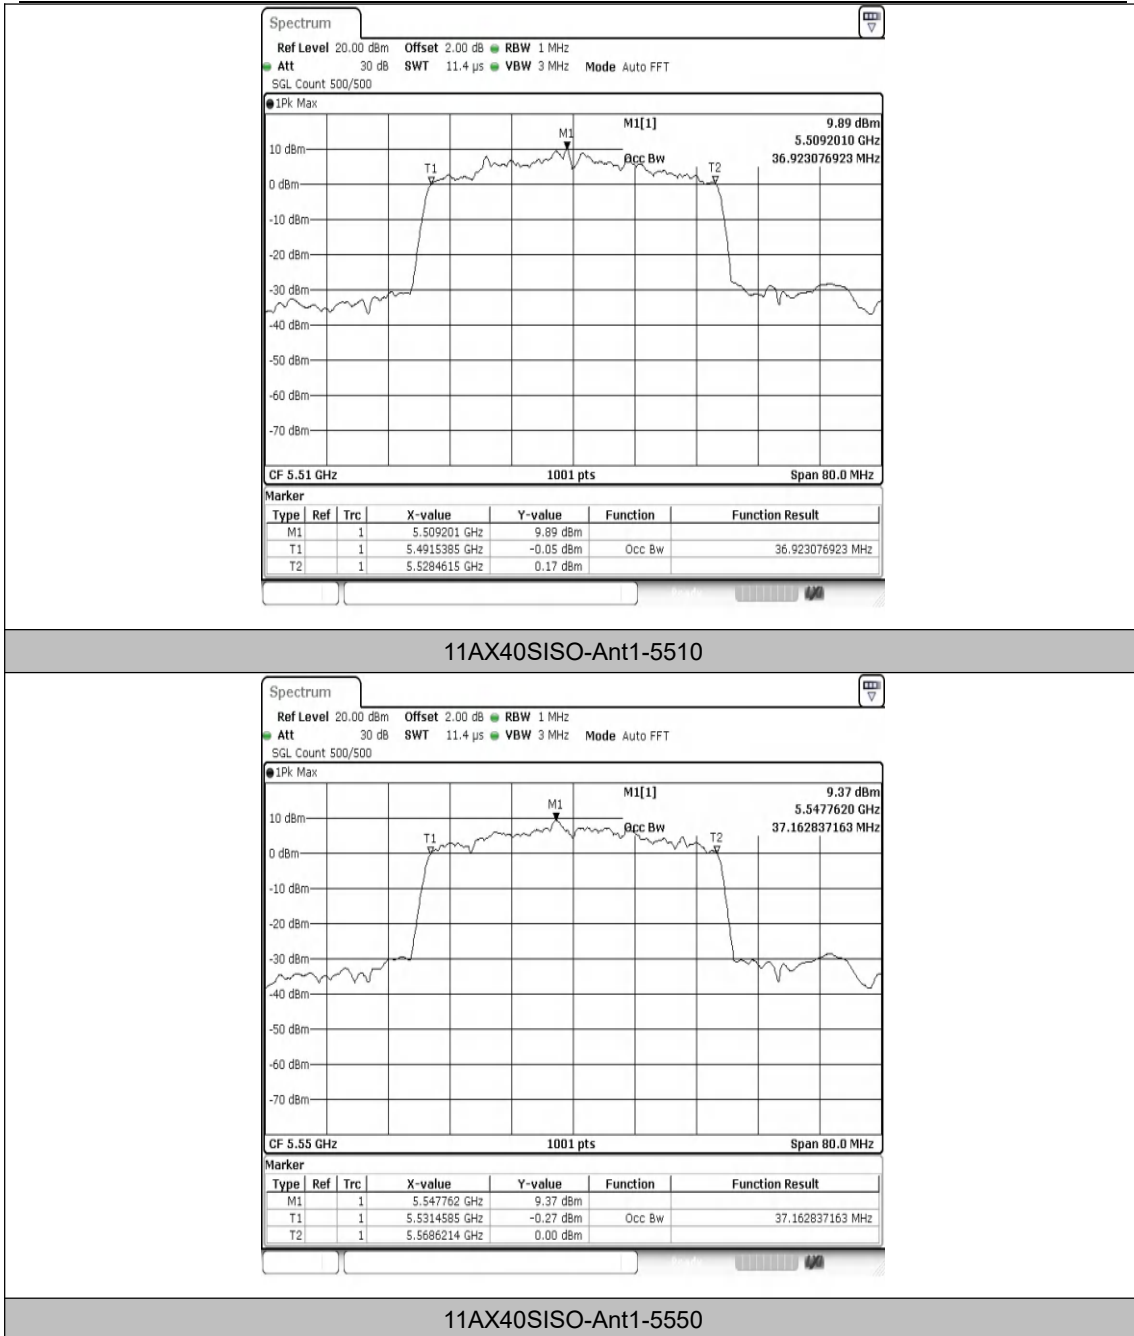

#### Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: [www.anbotek.com](http://www.anbotek.com) E-mail: [service@anbotek.com](mailto:service@anbotek.com)