

Appendix Test Data

Report No.:	1812C50023312503	Test Sample No.:	1-2-2
Start Test Date:	2025-1-16	Finish Test Date:	2025-5-16
Test Engineer:	Hu Sen Guan	Auditor:	Justin Feng
Temperature:	24.3°C	Relative Humidity:	46%
Pressure:	101kPa		


Appendix A: 6dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	6dB BW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	8.24	2407.80	2416.04	0.5	PASS
11B	Ant2	2412	8.24	2407.80	2416.04	0.5	PASS
11B	Ant1	2437	8.24	2432.80	2441.04	0.5	PASS
11B	Ant2	2437	8.28	2432.80	2441.08	0.5	PASS
11B	Ant1	2462	8.28	2457.80	2466.08	0.5	PASS
11B	Ant2	2462	8.28	2457.80	2466.08	0.5	PASS
11G	Ant1	2412	16.08	2403.92	2420.00	0.5	PASS
11G	Ant2	2412	16.28	2403.88	2420.16	0.5	PASS
11G	Ant1	2437	16.40	2428.64	2445.04	0.5	PASS
11G	Ant2	2437	16.28	2428.88	2445.16	0.5	PASS
11G	Ant1	2462	16.36	2453.76	2470.12	0.5	PASS
11G	Ant2	2462	15.56	2454.00	2469.56	0.5	PASS
11N20MIMO	Ant1	2412	17.24	2403.16	2420.40	0.5	PASS
11N20MIMO	Ant2	2412	17.04	2403.64	2420.68	0.5	PASS
11N20MIMO	Ant1	2437	16.96	2428.40	2445.36	0.5	PASS
11N20MIMO	Ant2	2437	17.20	2428.20	2445.40	0.5	PASS
11N20MIMO	Ant1	2462	17.12	2453.28	2470.40	0.5	PASS
11N20MIMO	Ant2	2462	16.60	2453.56	2470.16	0.5	PASS
11N40MIMO	Ant1	2422	35.68	2403.92	2439.60	0.5	PASS
11N40MIMO	Ant2	2422	35.20	2404.40	2439.60	0.5	PASS
11N40MIMO	Ant1	2437	35.28	2419.00	2454.28	0.5	PASS
11N40MIMO	Ant2	2437	35.52	2419.24	2454.76	0.5	PASS
11N40MIMO	Ant1	2452	35.68	2434.08	2469.76	0.5	PASS
11N40MIMO	Ant2	2452	35.44	2434.40	2469.84	0.5	PASS
11AX20MIMO	Ant1	2412	16.12	2403.72	2419.84	0.5	PASS

11AX20MIMO	Ant2	2412	17.28	2403.32	2420.60	0.5	PASS
11AX20MIMO	Ant1	2437	18.00	2428.32	2446.32	0.5	PASS
11AX20MIMO	Ant2	2437	15.60	2429.40	2445.00	0.5	PASS
11AX20MIMO	Ant1	2462	16.92	2453.68	2470.60	0.5	PASS
11AX20MIMO	Ant2	2462	17.00	2453.84	2470.84	0.5	PASS
11AX40MIMO	Ant1	2422	36.24	2403.28	2439.52	0.5	PASS
11AX40MIMO	Ant2	2422	36.00	2404.24	2440.24	0.5	PASS
11AX40MIMO	Ant1	2437	34.24	2419.88	2454.12	0.5	PASS
11AX40MIMO	Ant2	2437	35.04	2419.40	2454.44	0.5	PASS
11AX40MIMO	Ant1	2452	35.84	2433.60	2469.44	0.5	PASS
11AX40MIMO	Ant2	2452	34.48	2434.72	2469.20	0.5	PASS


Test Graphs

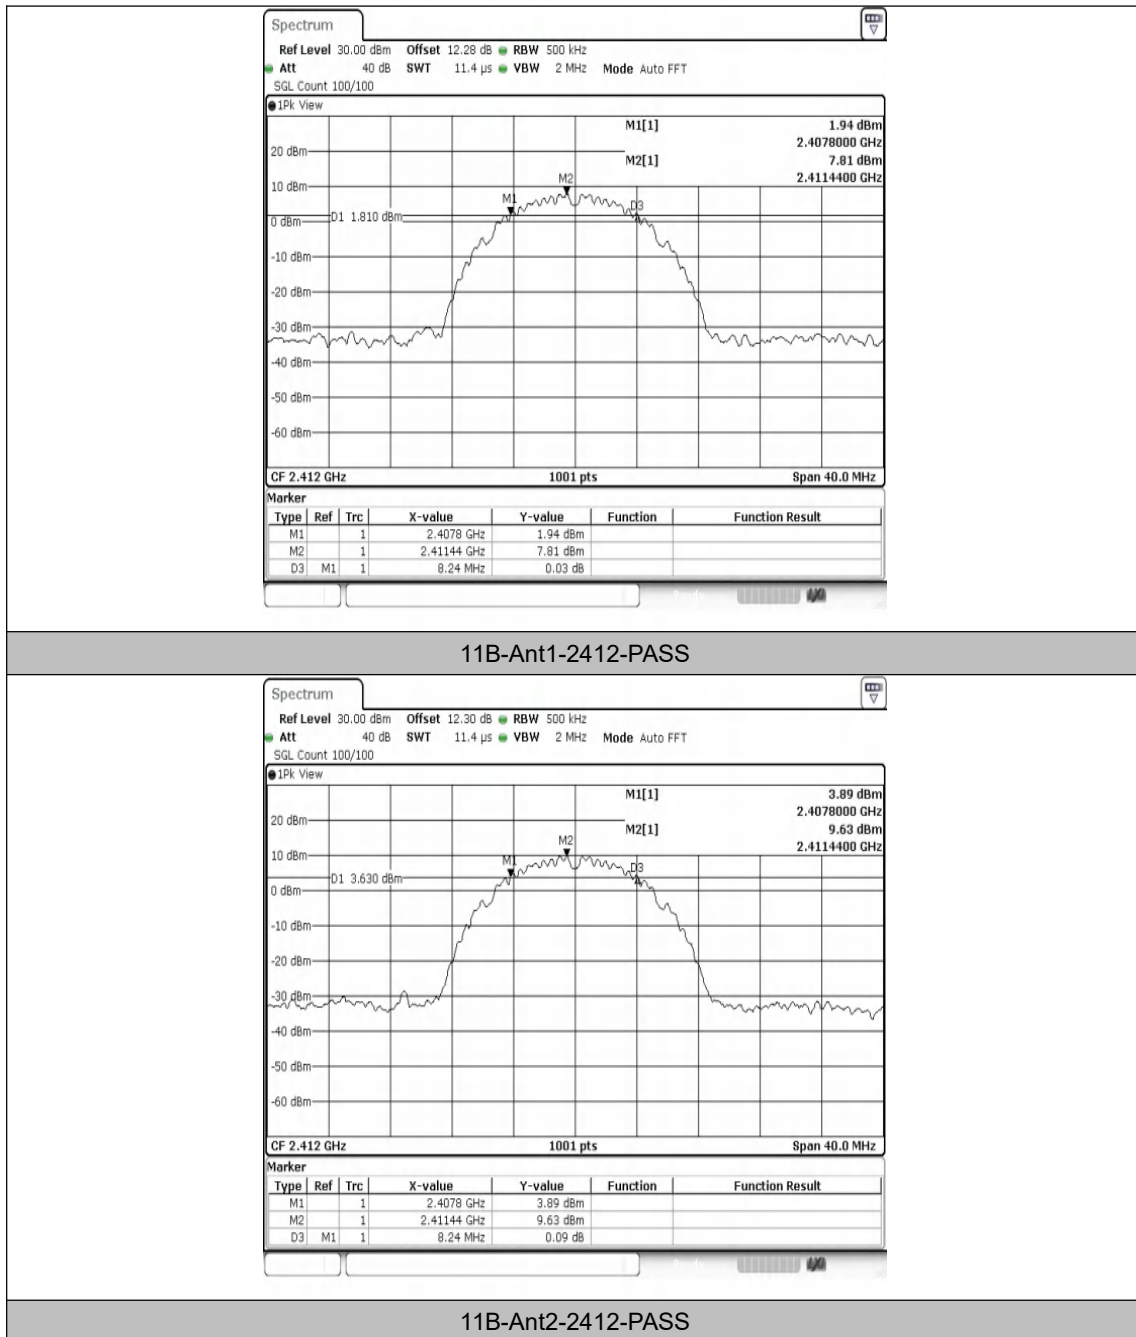



Shenzhen Anbotech Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

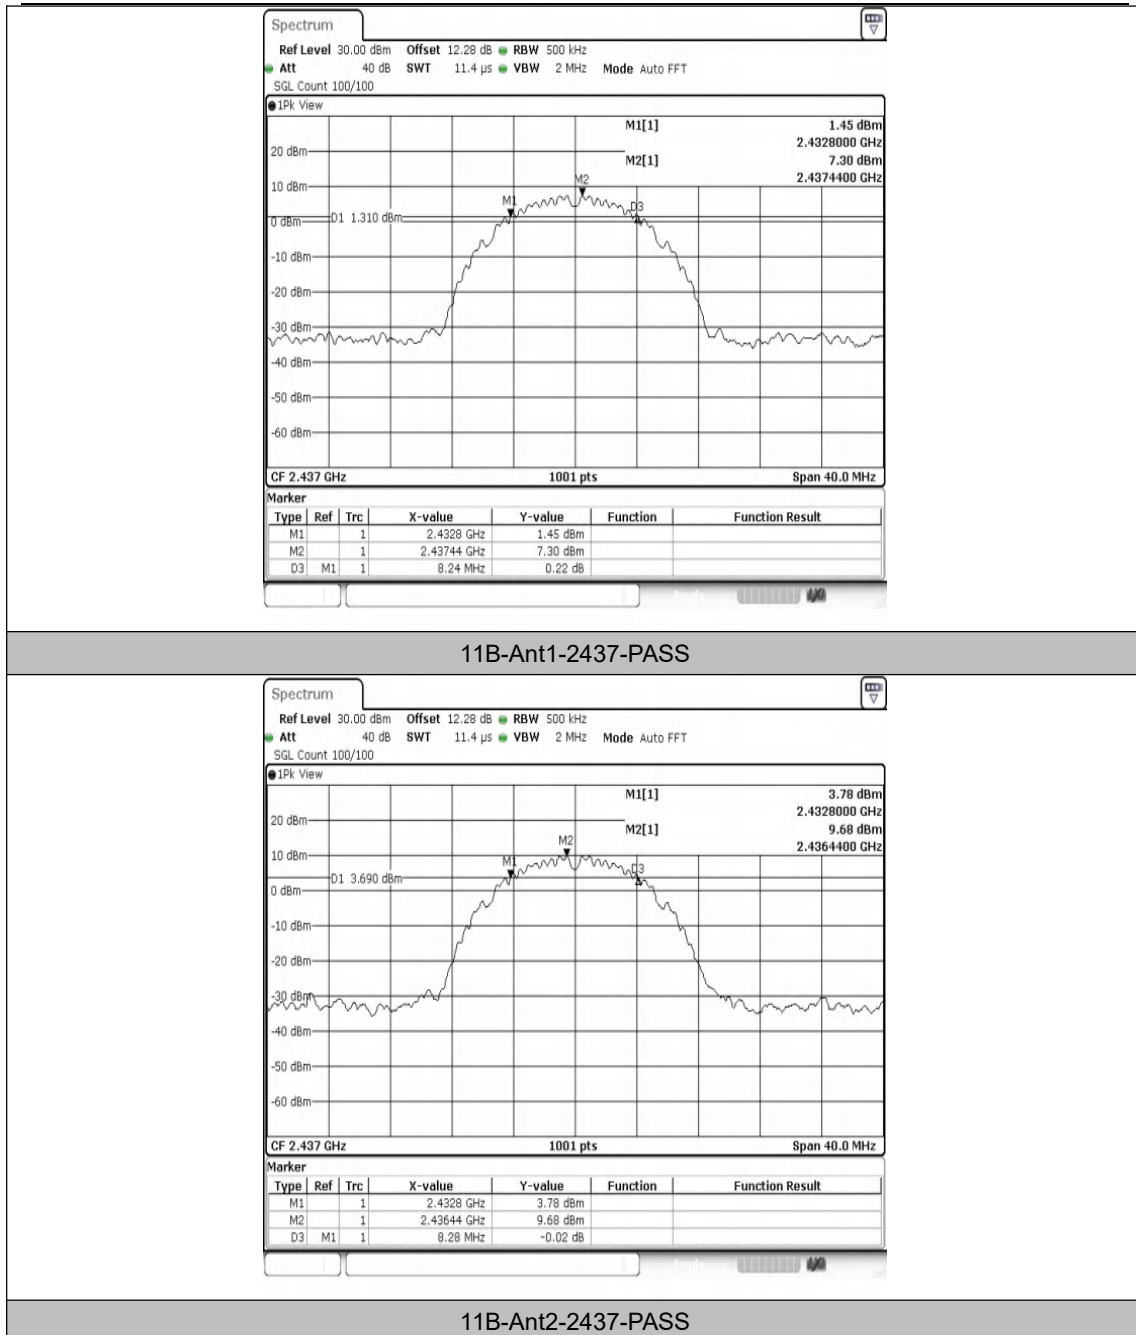


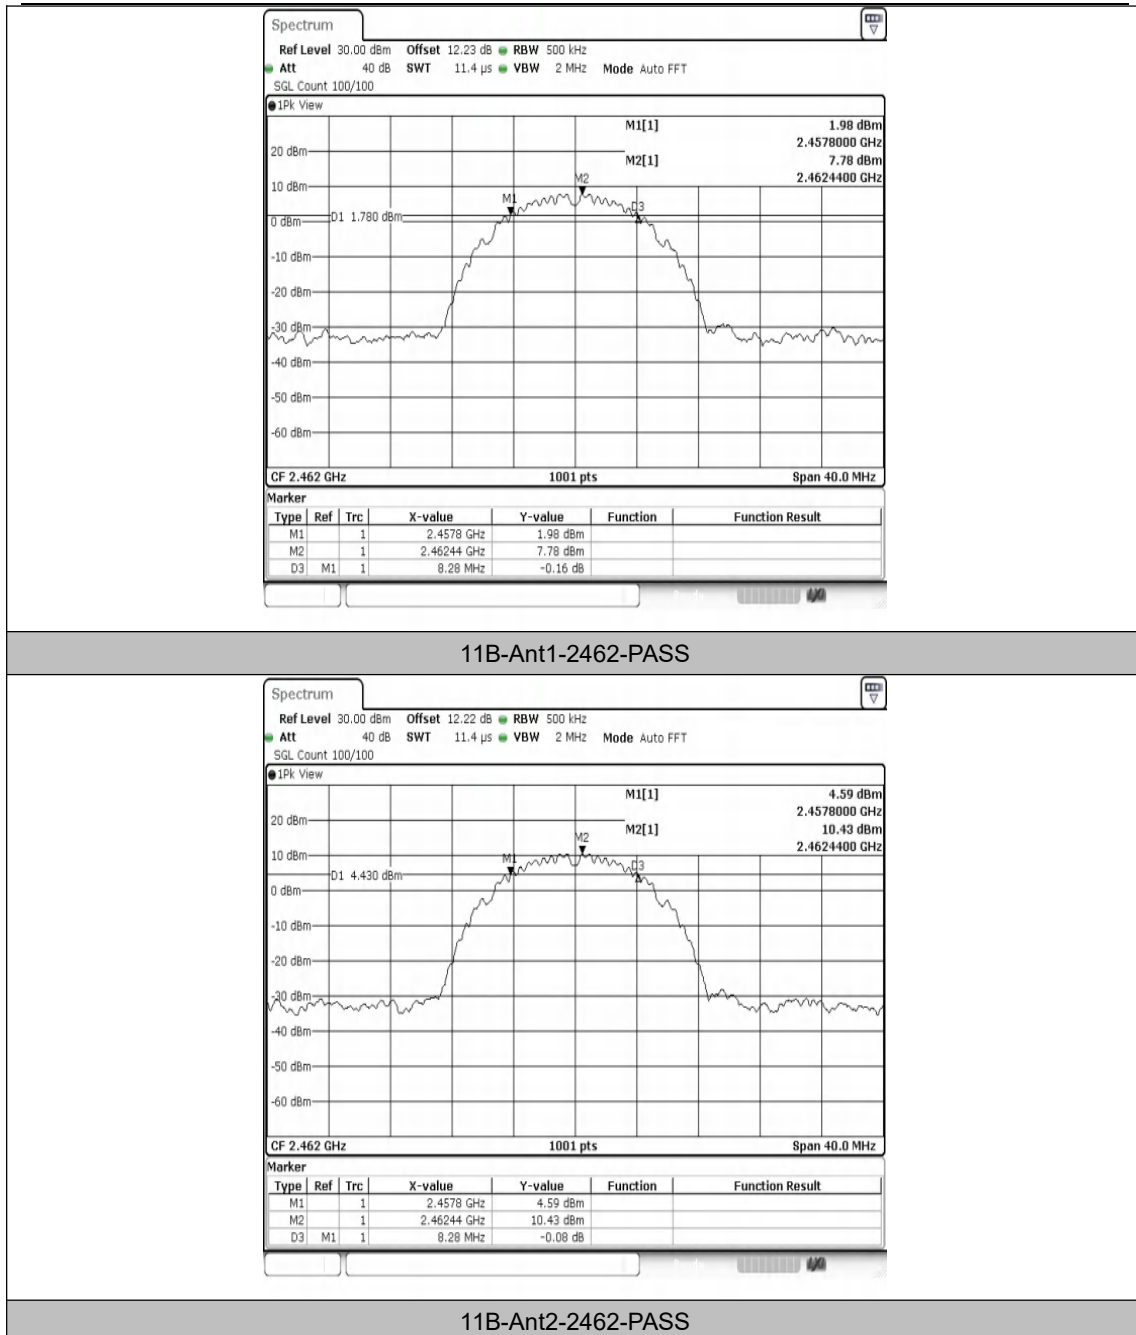

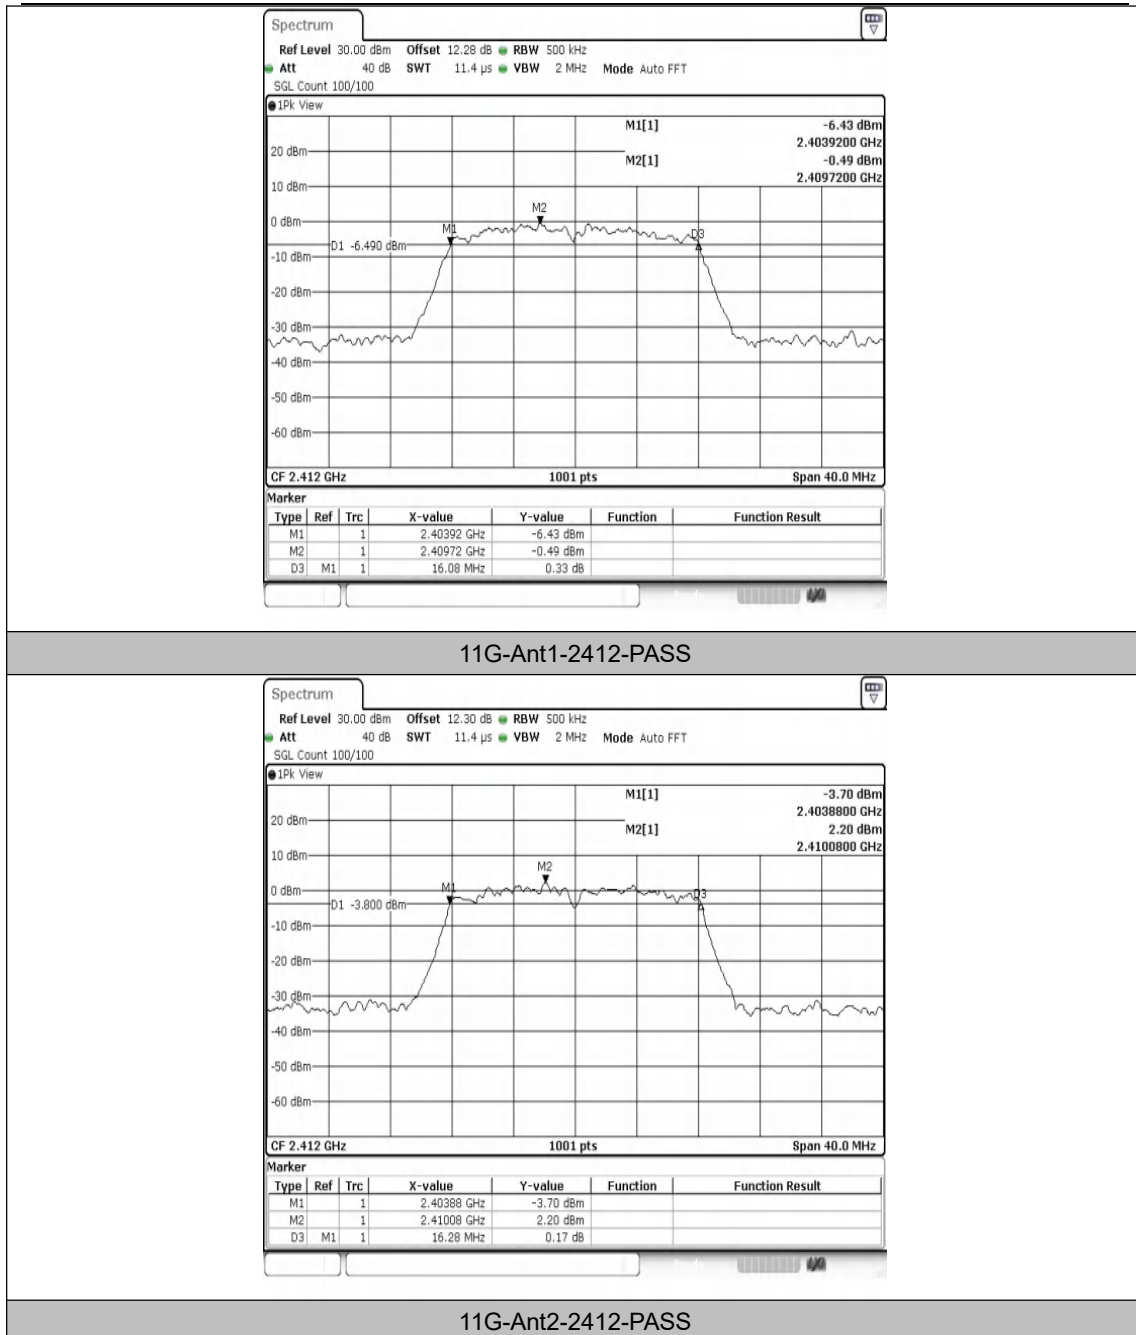


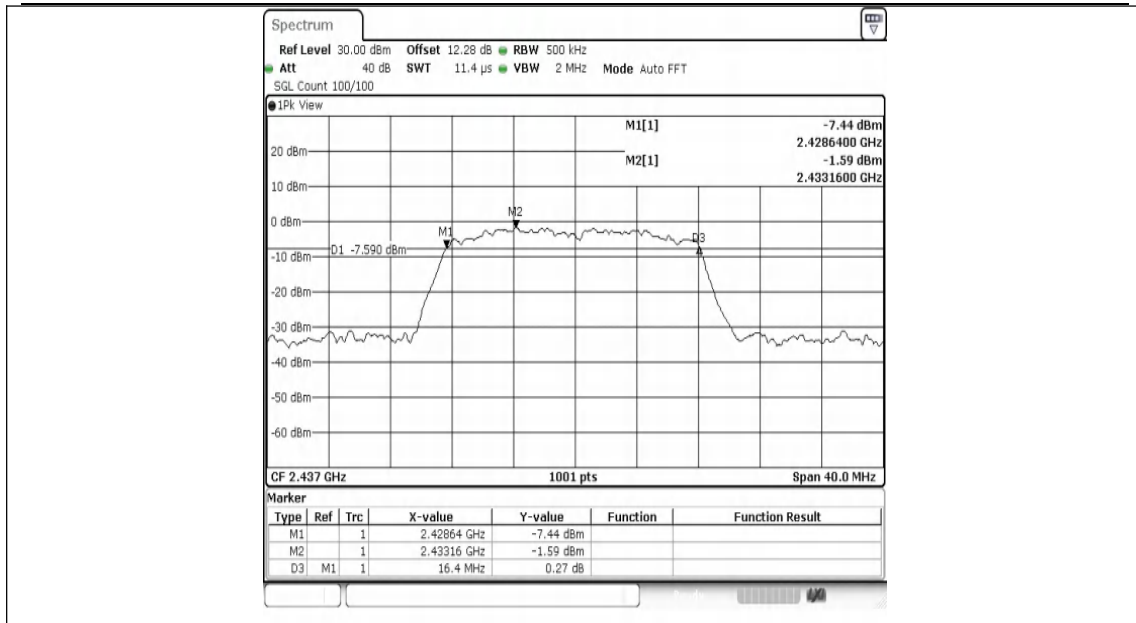



11G-Ant1-2437-PASS

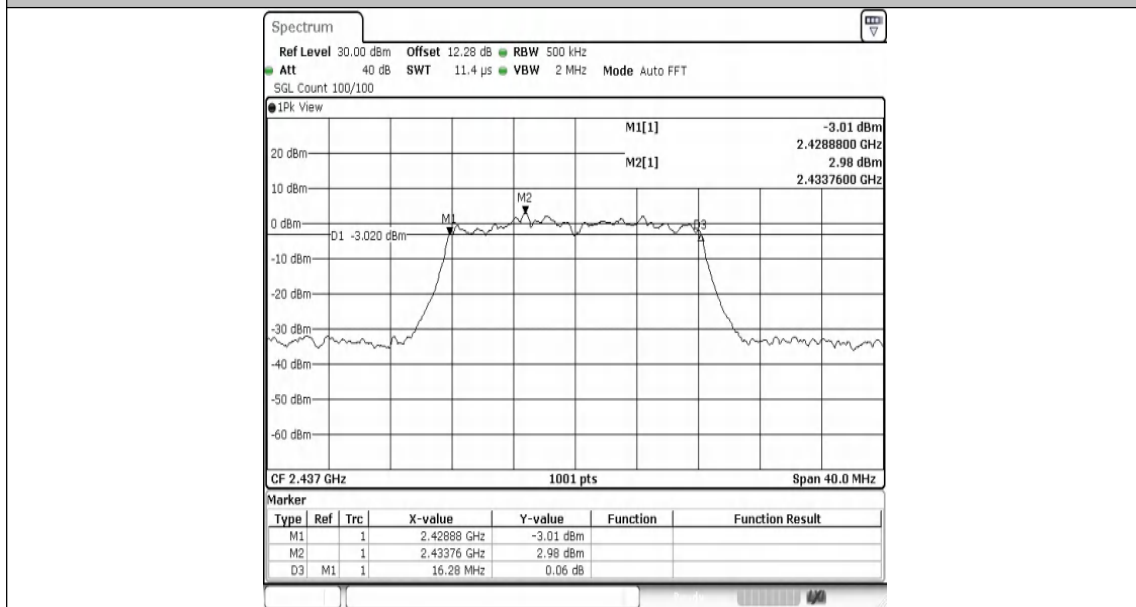



11G-Ant2-2437-PASS

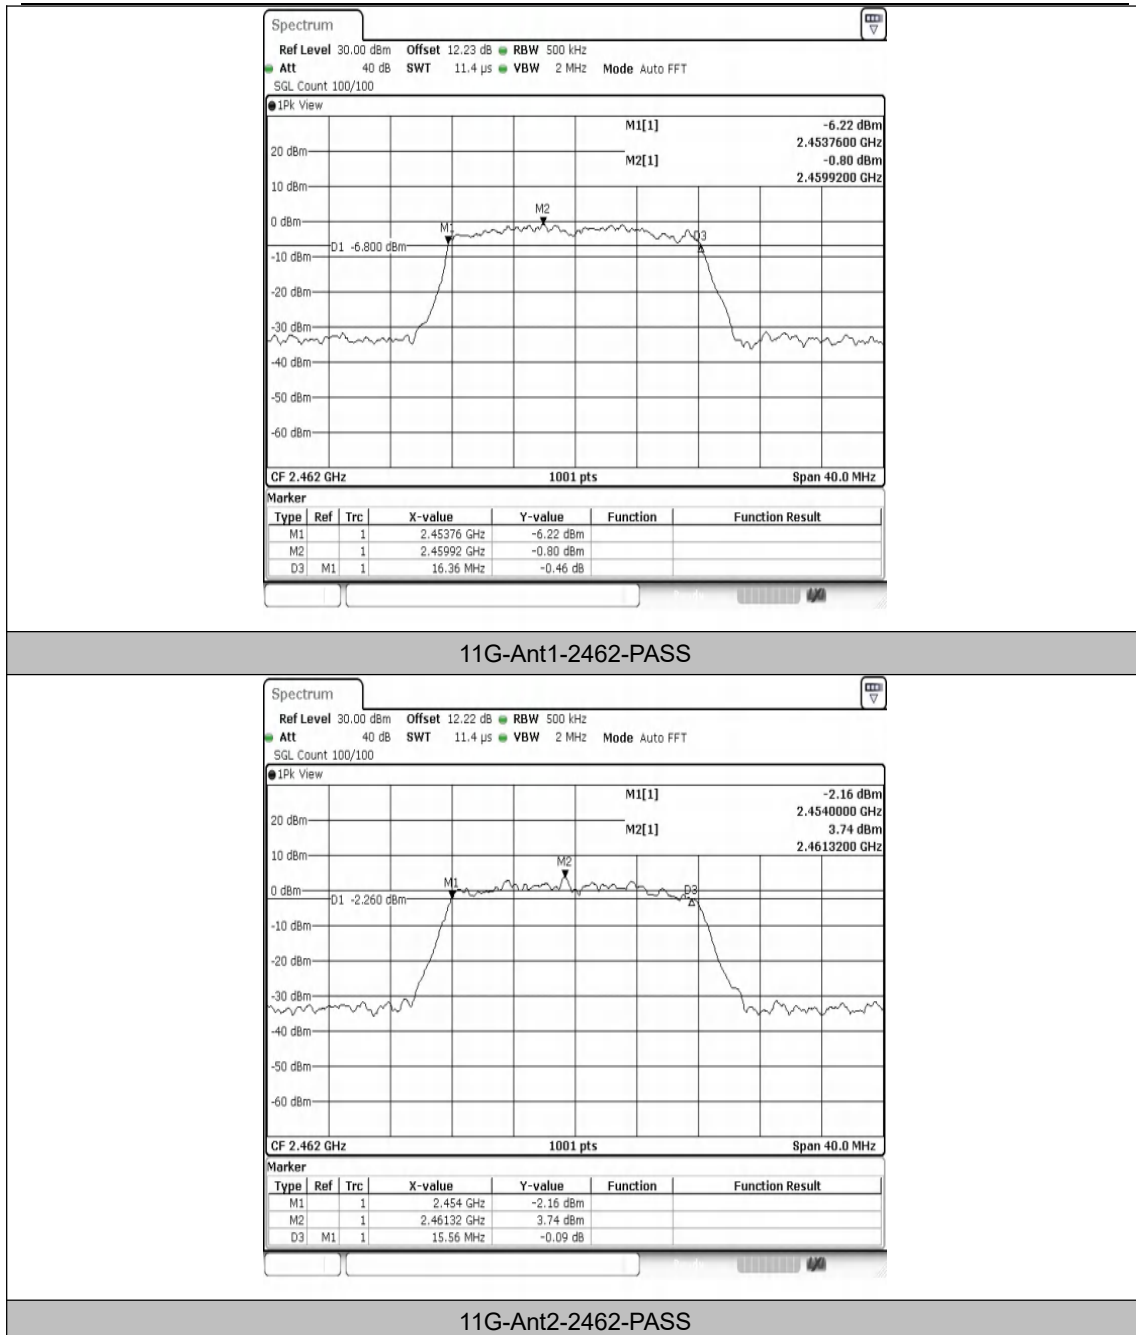


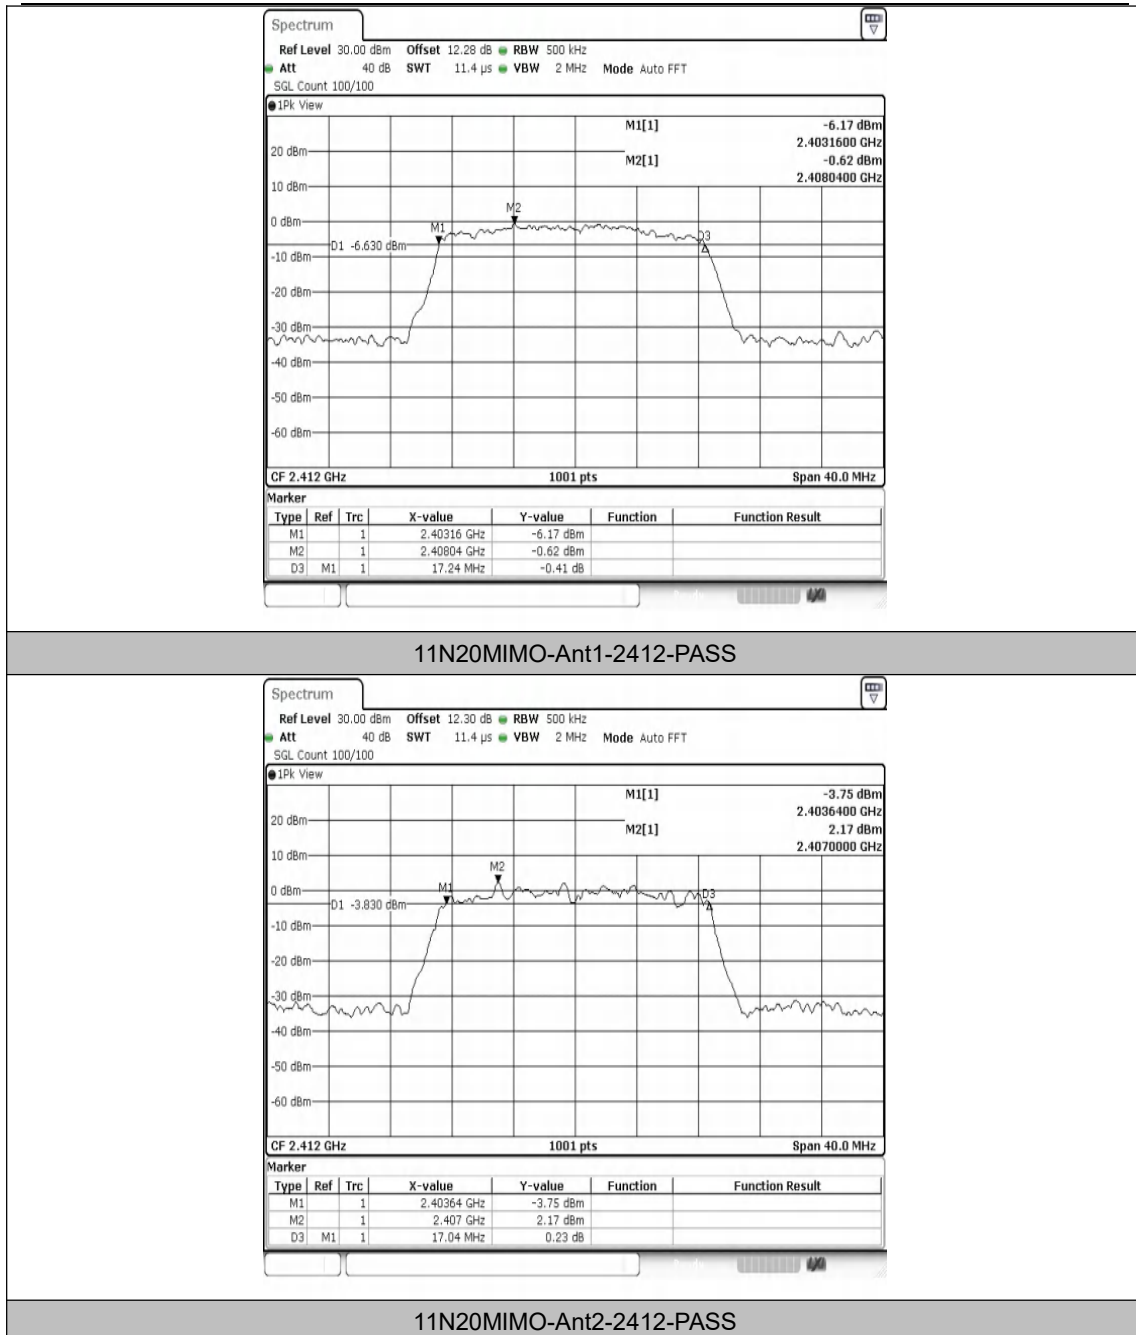


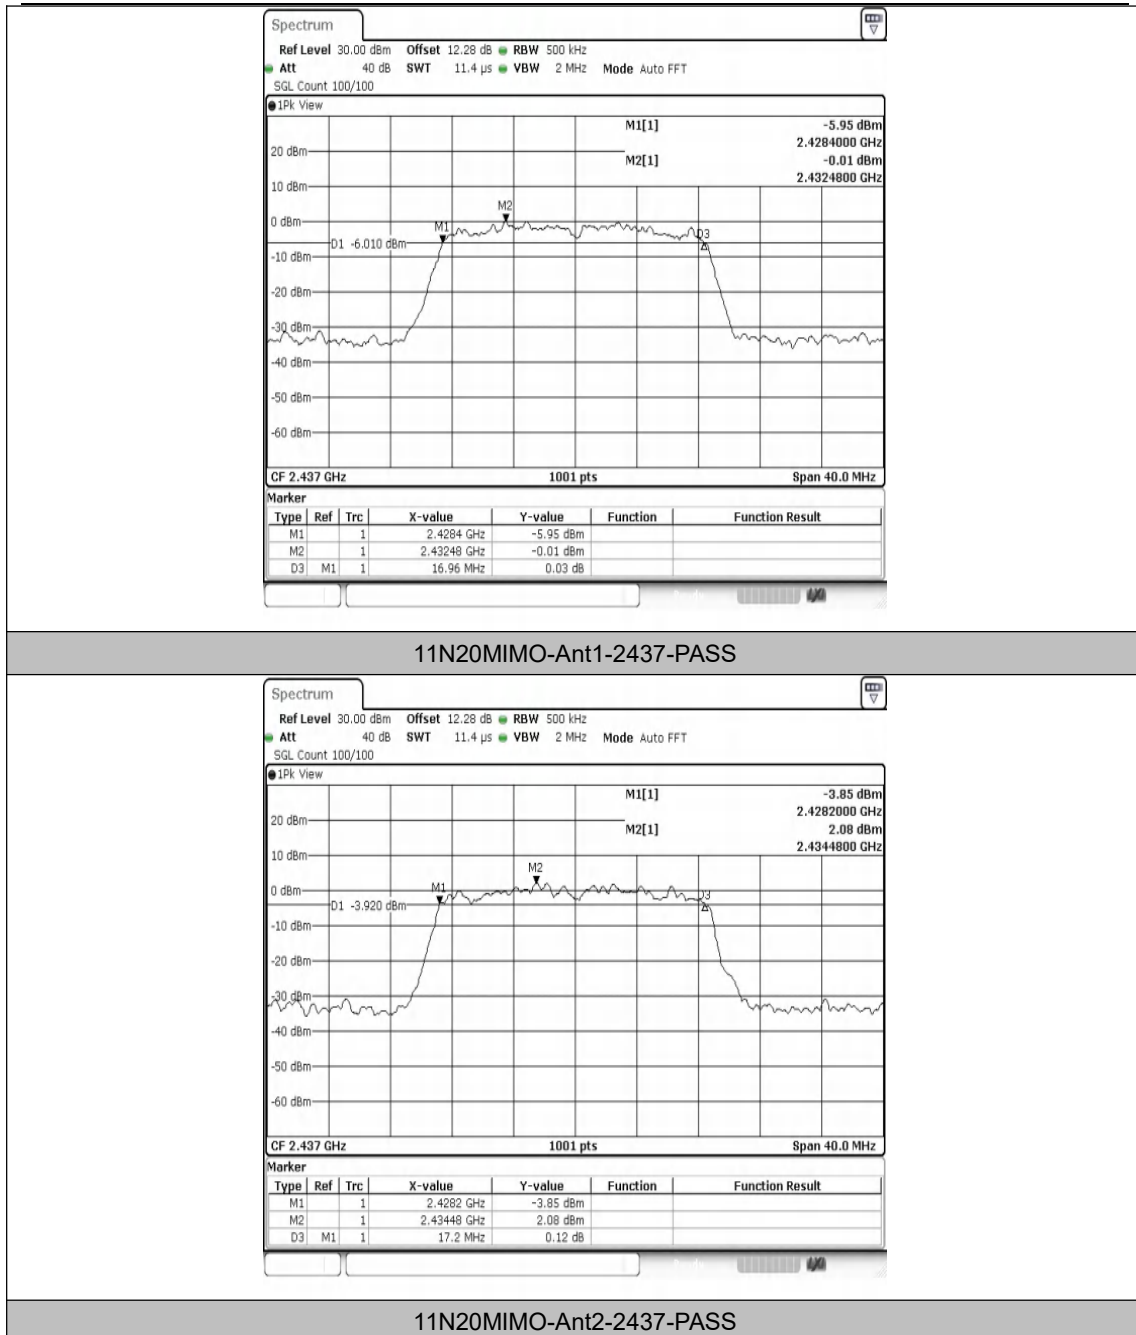


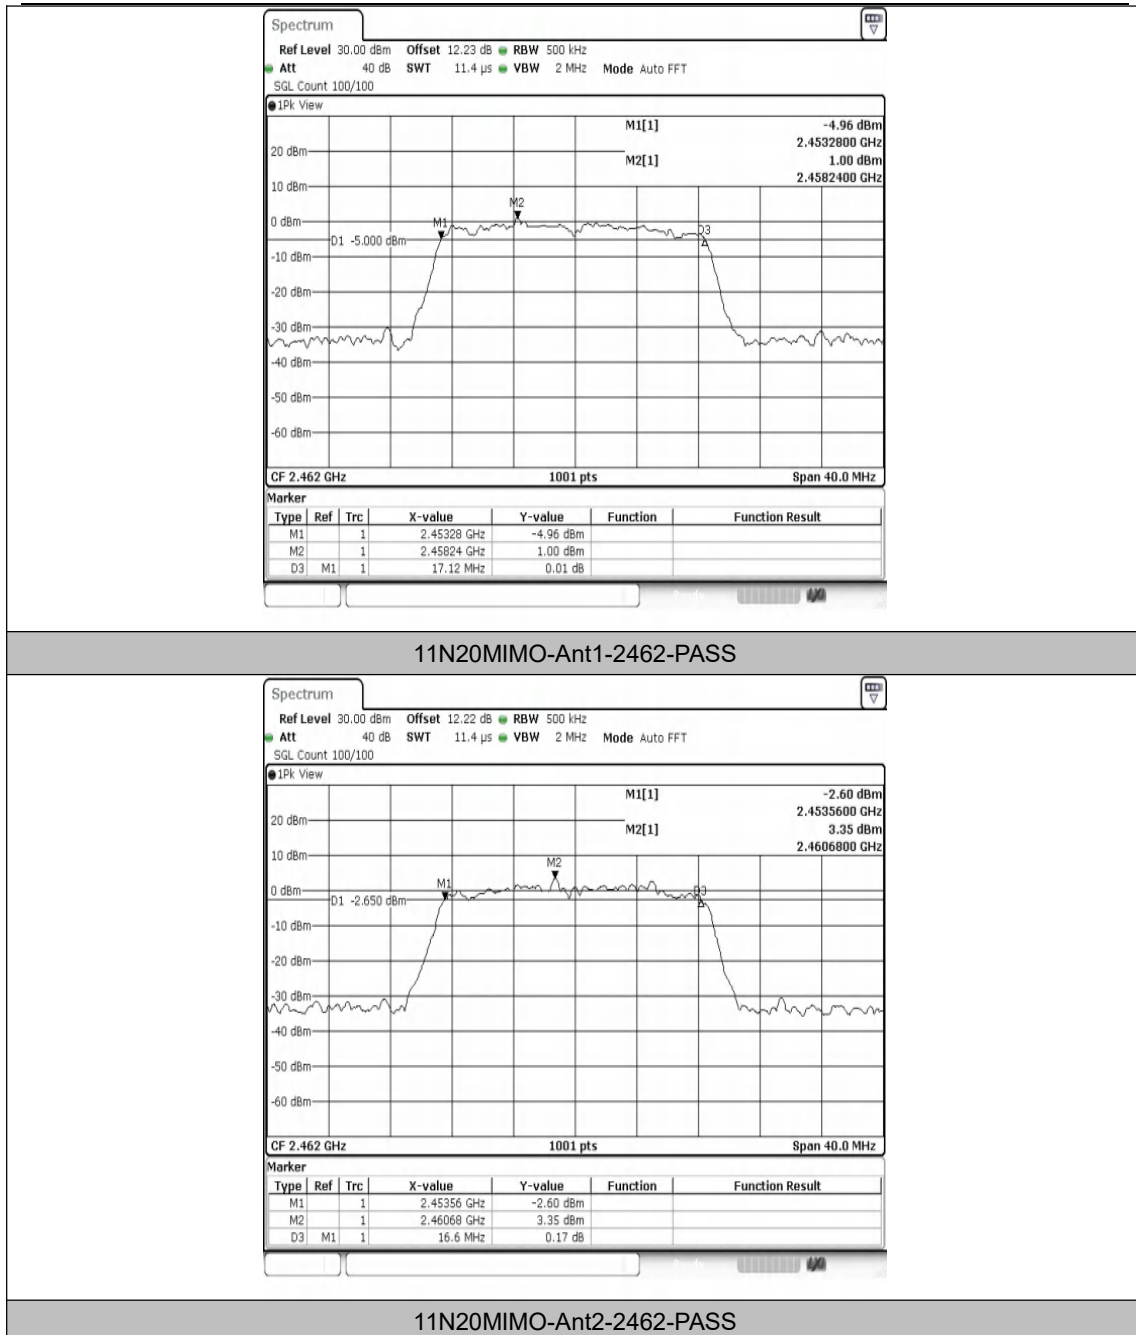


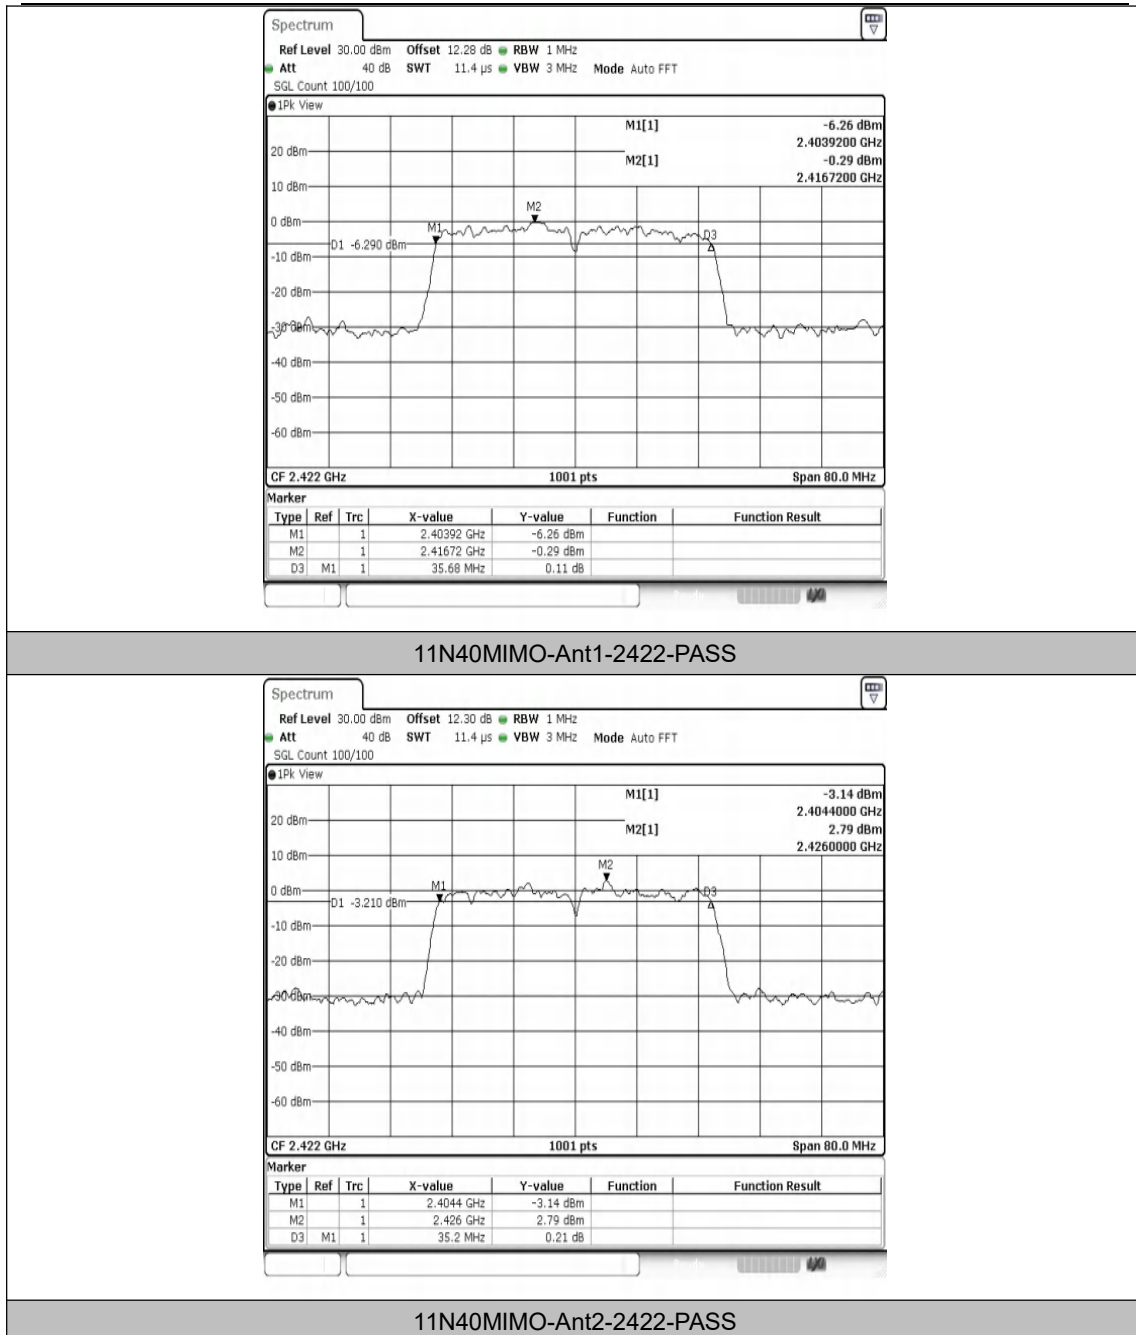

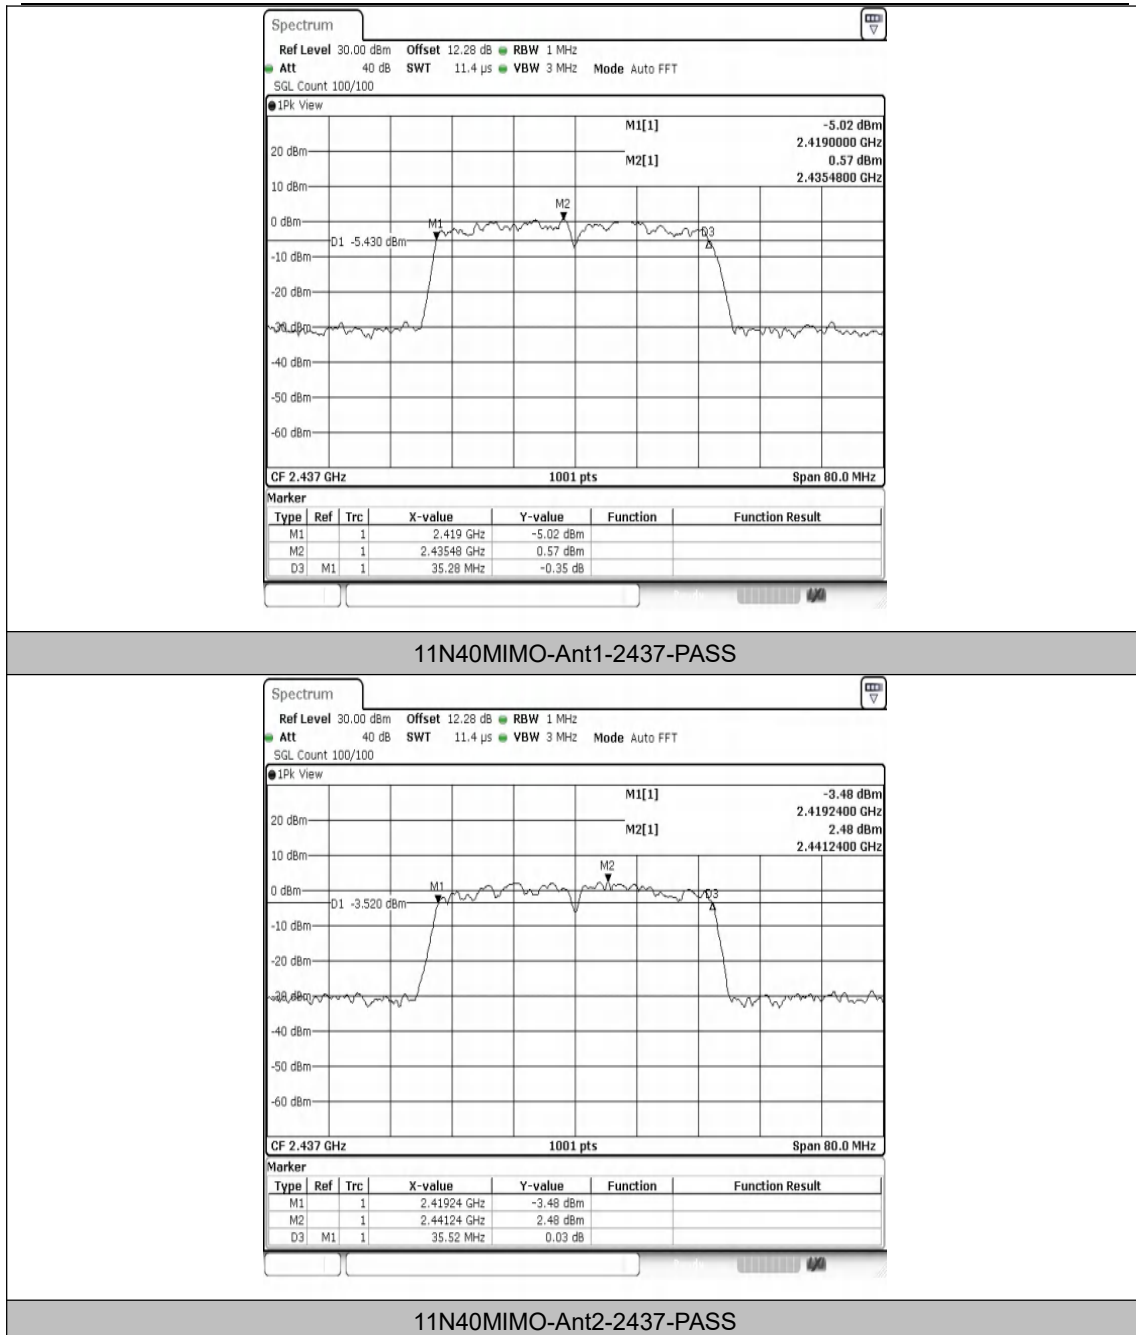

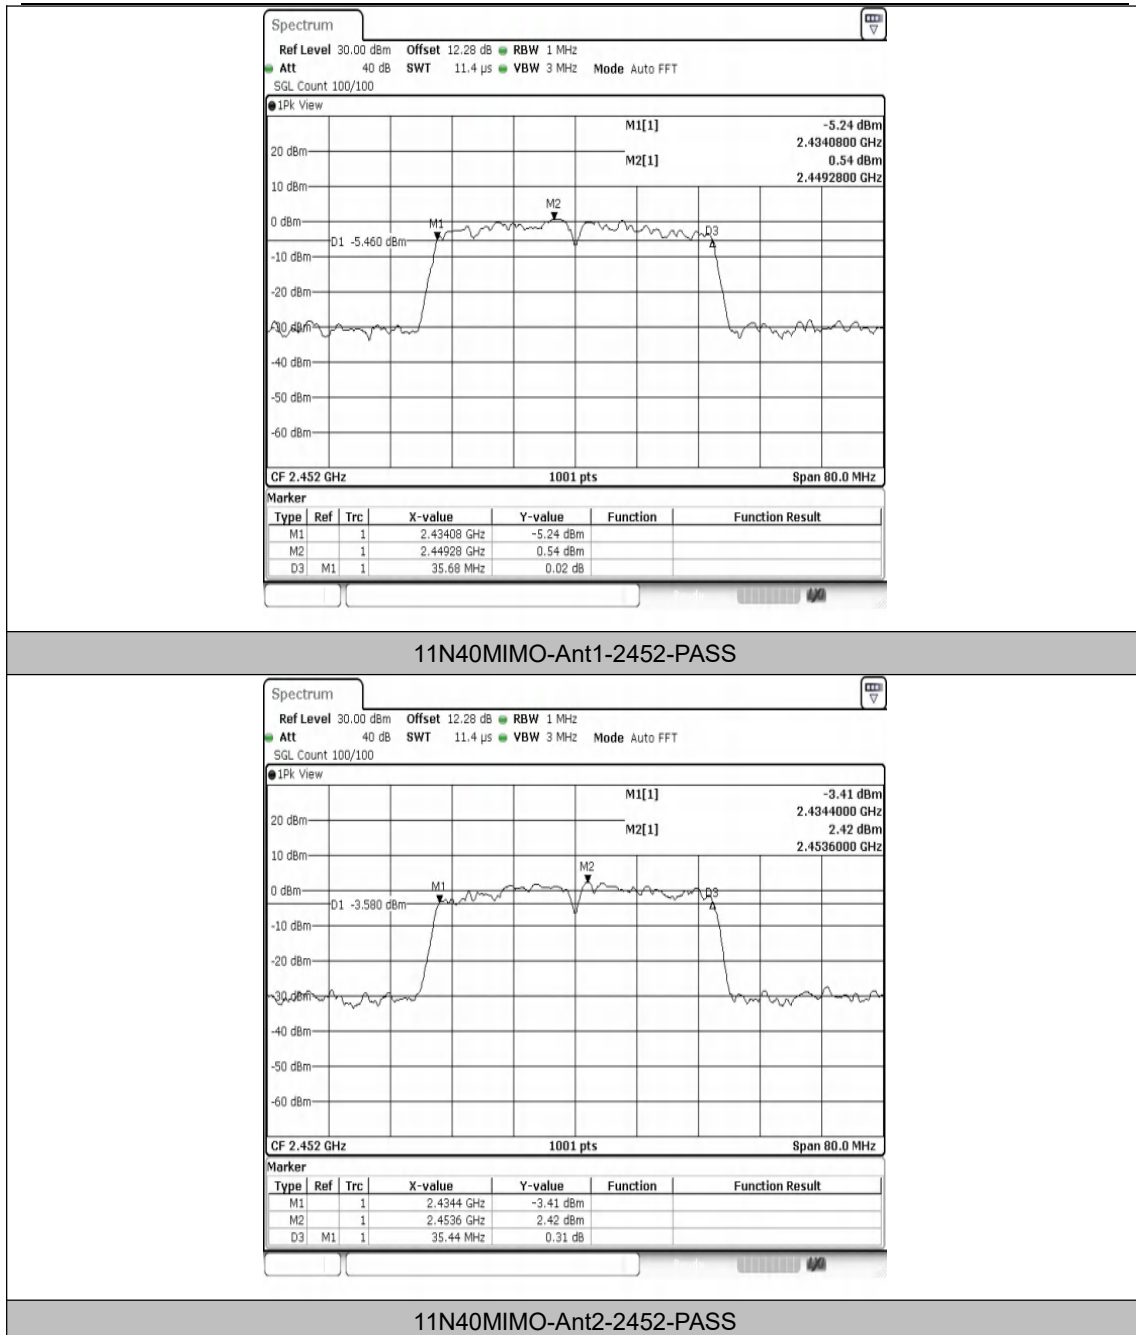

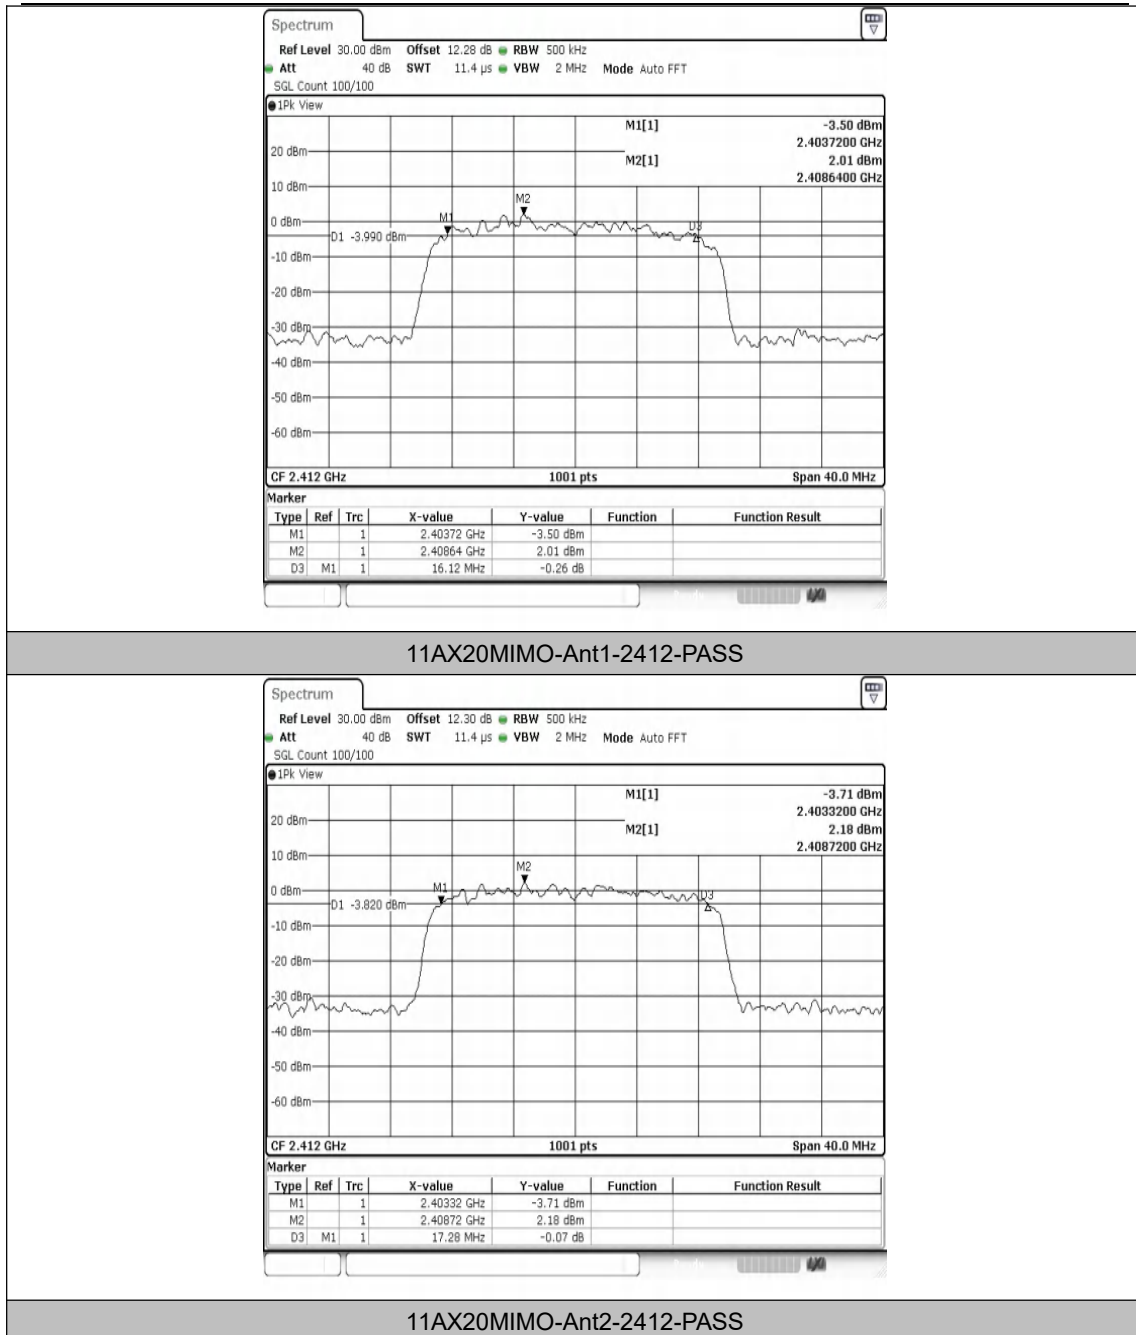


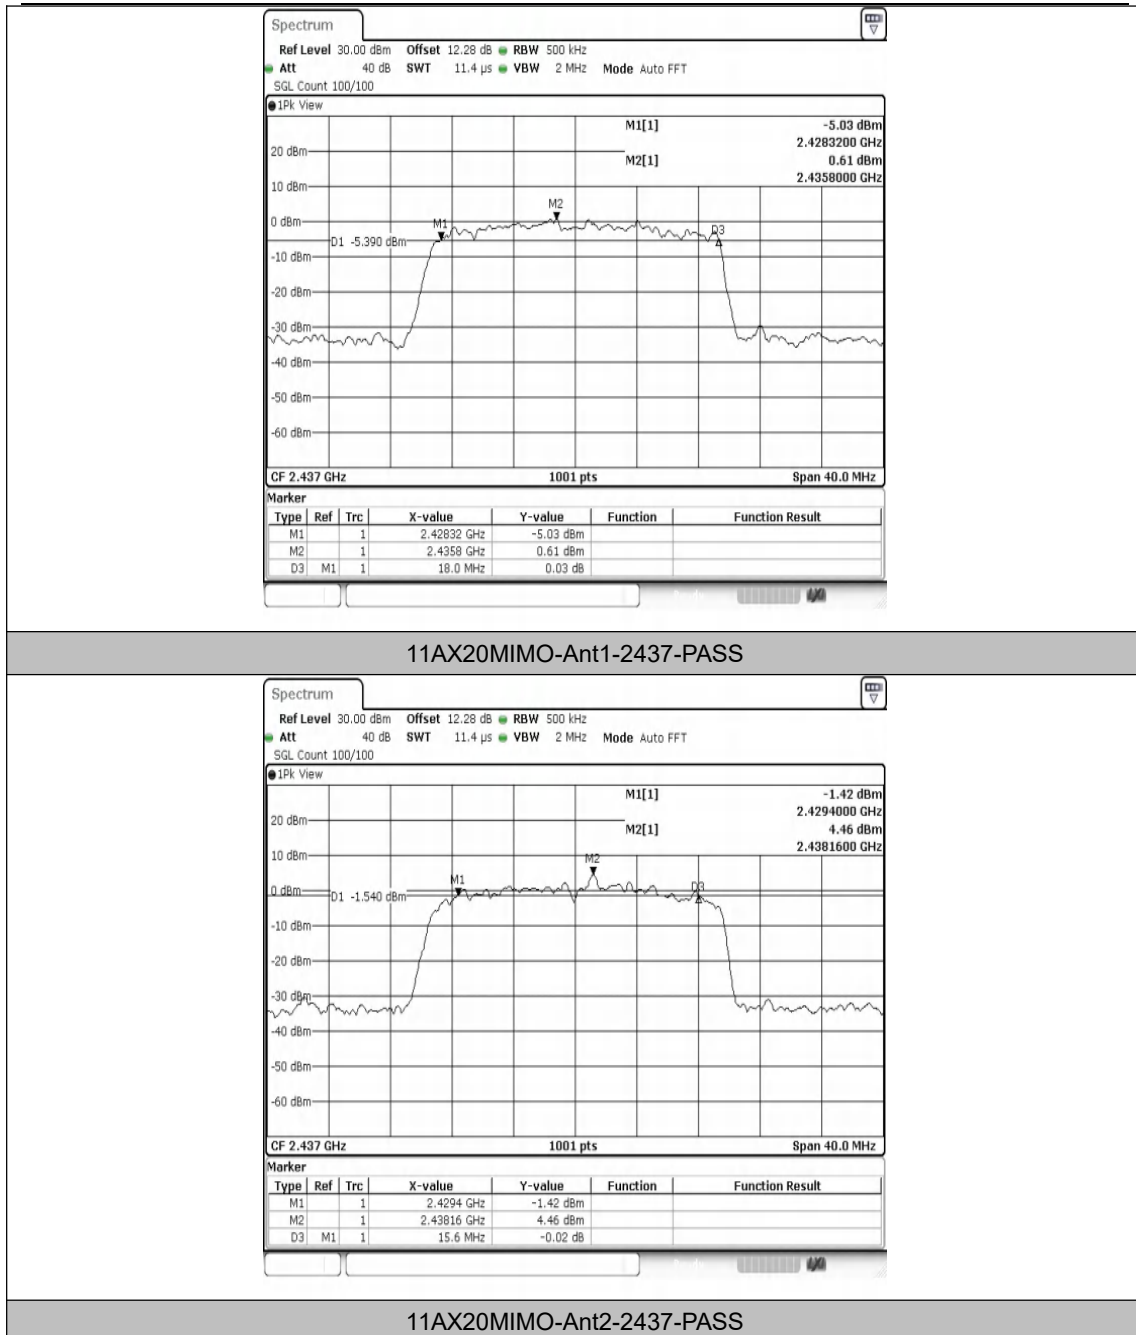



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

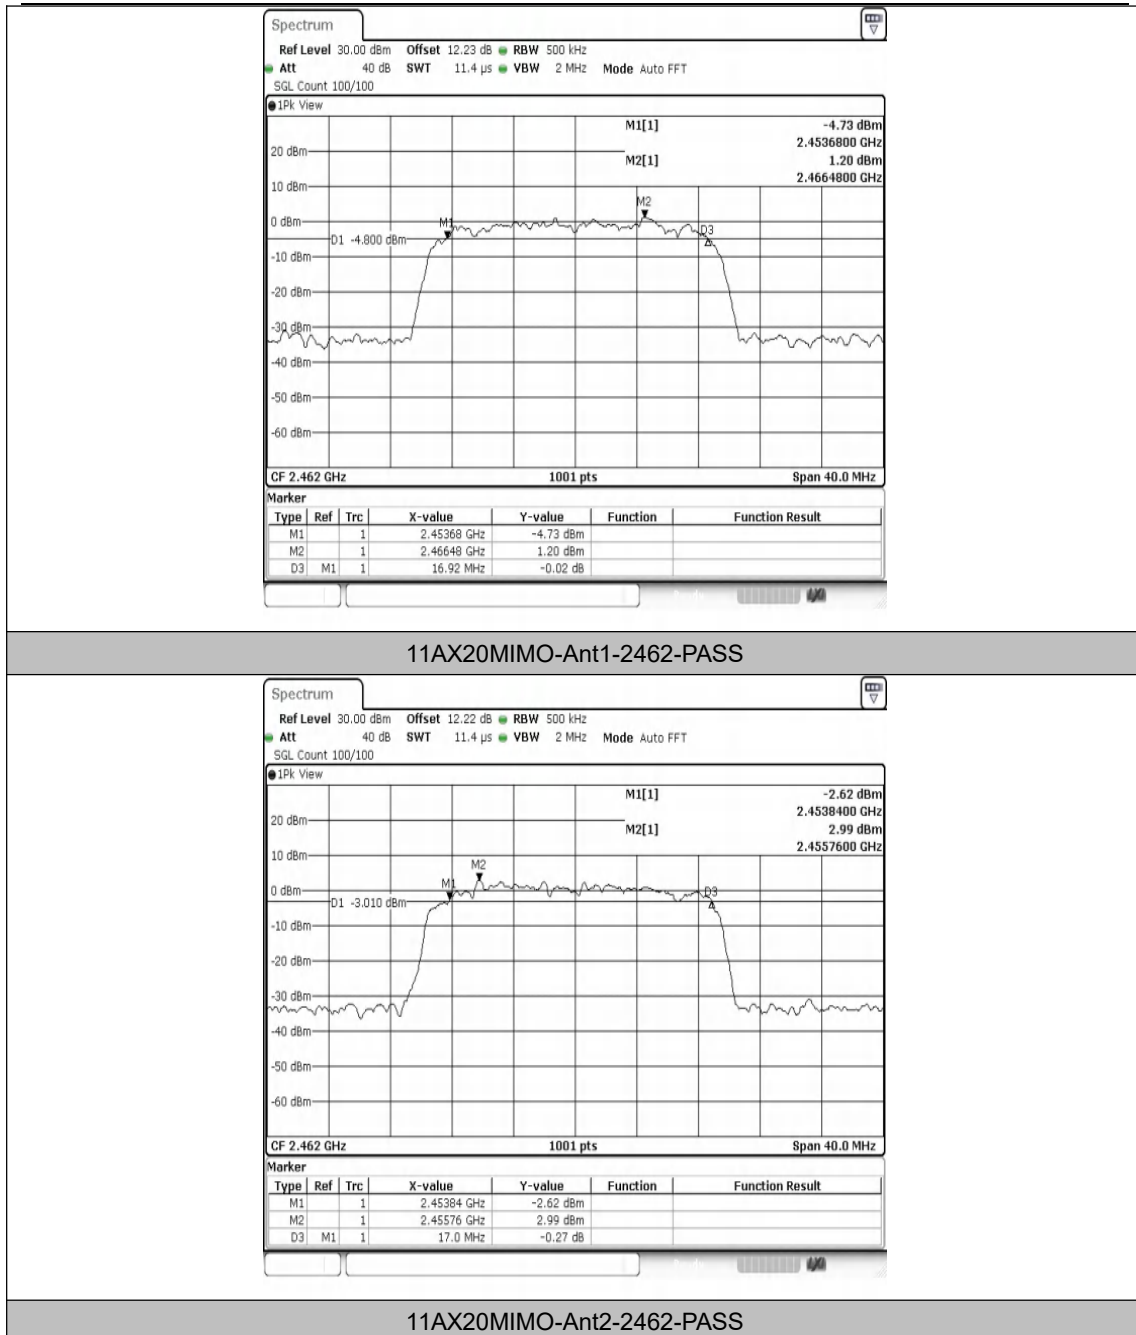

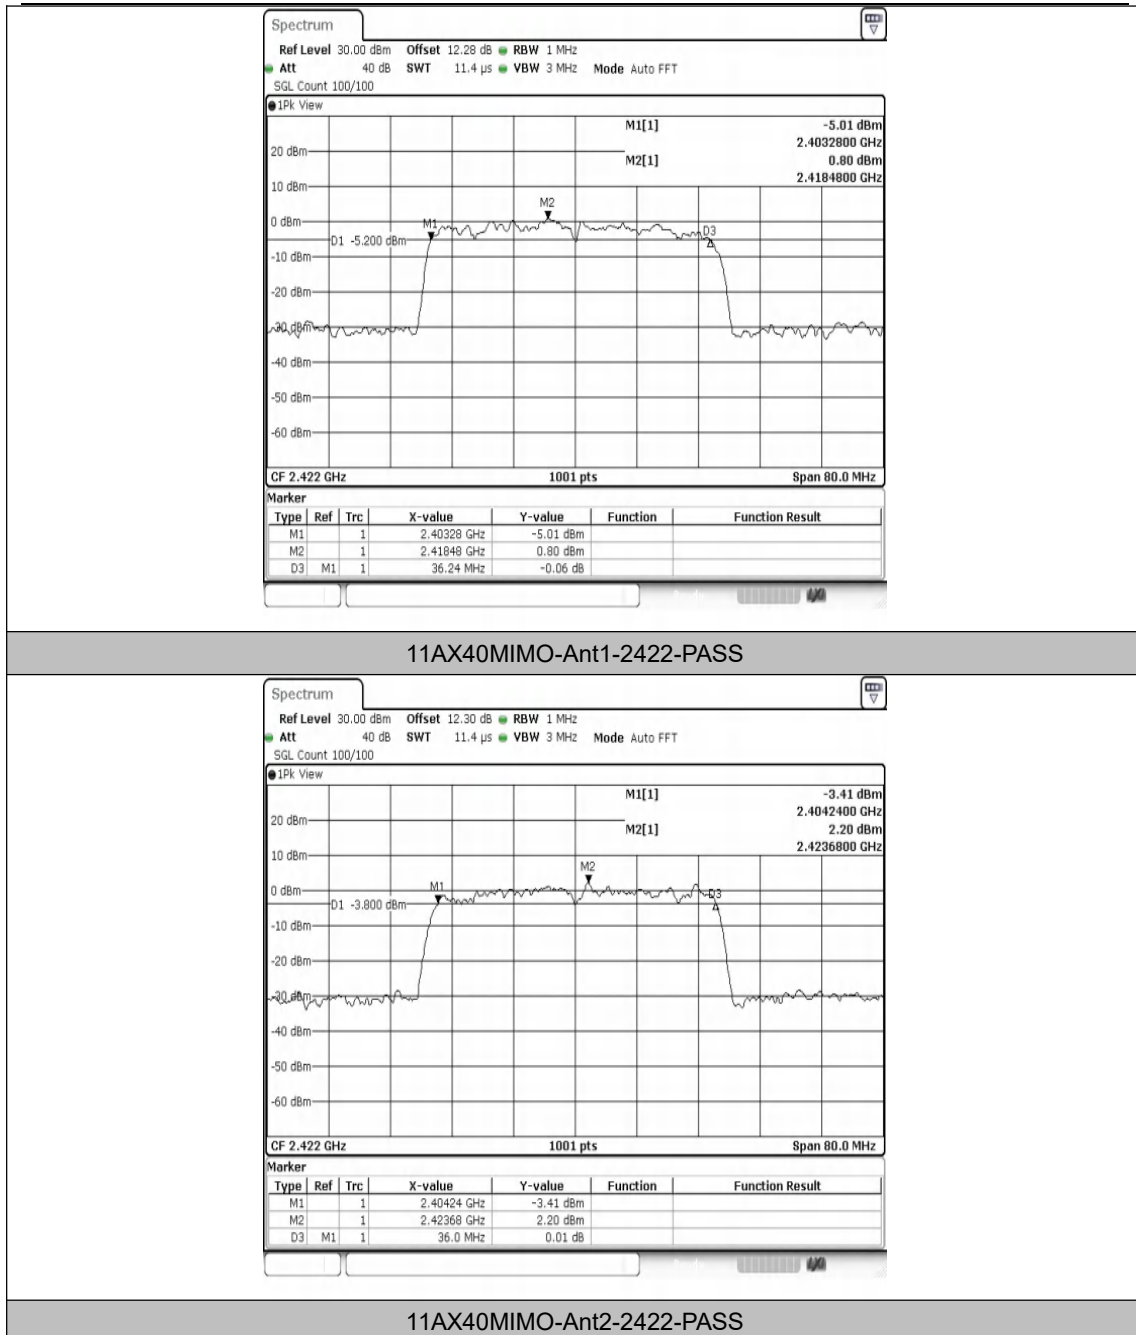

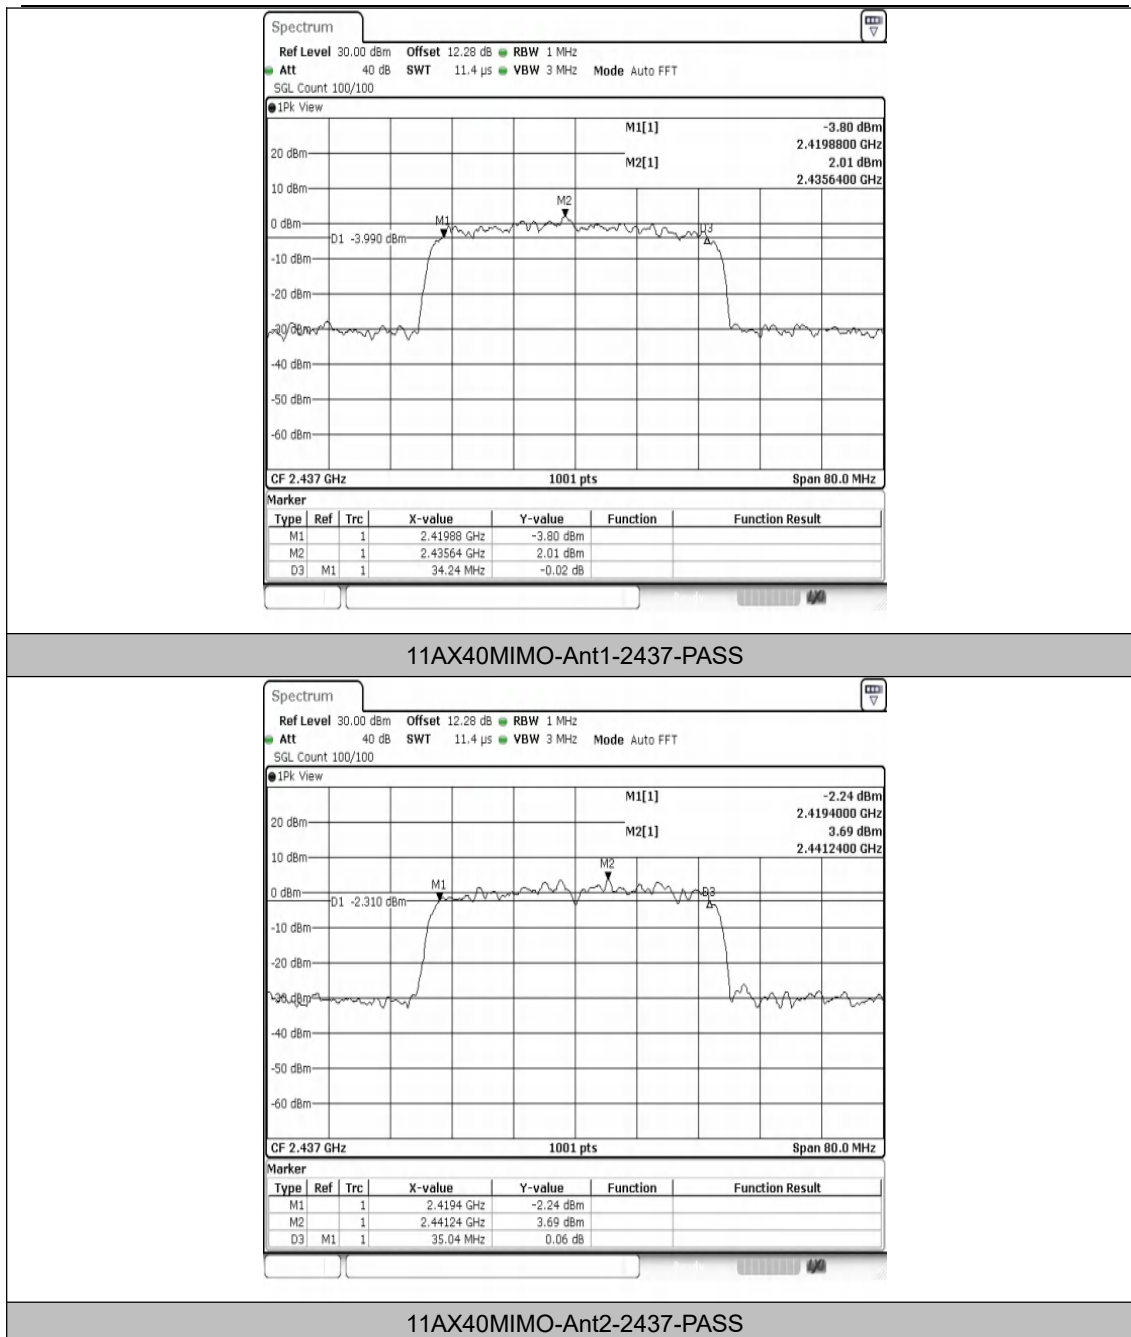

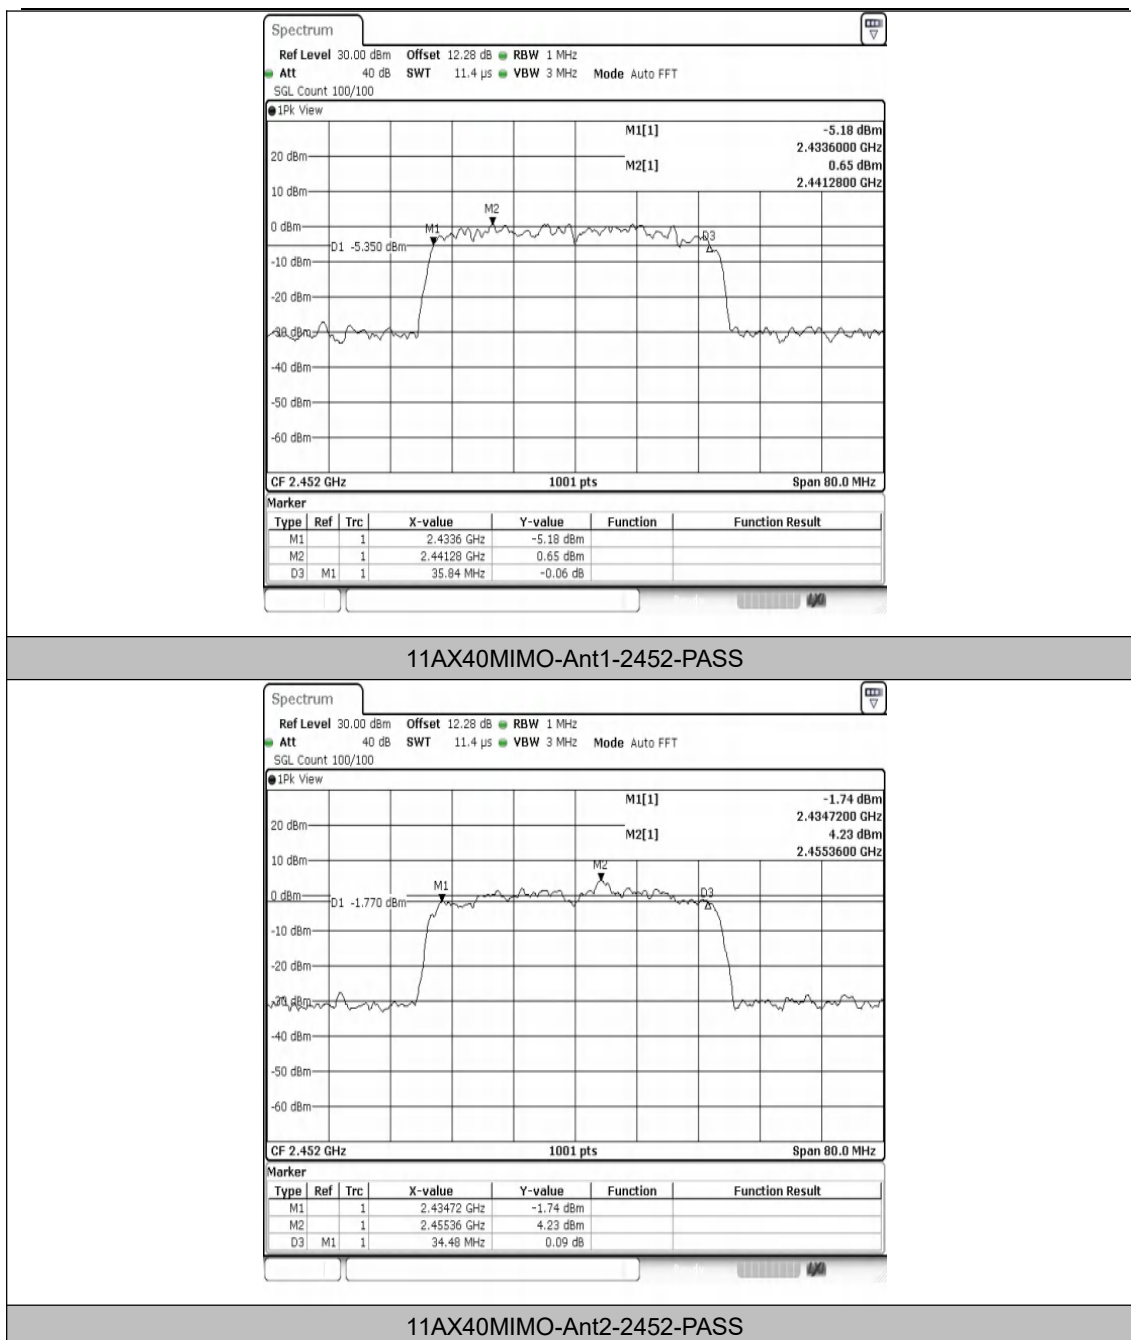


Appendix B: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Channel Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11B	Ant1	2412	12.148	2405.8462	2417.9940	---	---
11B	Ant2	2412	12.108	2405.8462	2417.9540	---	---
11B	Ant1	2437	12.148	2430.8462	2442.9940	---	---
11B	Ant2	2437	12.108	2430.8861	2442.9940	---	---
11B	Ant1	2462	12.108	2455.8861	2467.9940	---	---
11B	Ant2	2462	12.108	2455.8861	2467.9940	---	---
11G	Ant1	2412	16.623	2403.5684	2420.1918	---	---
11G	Ant2	2412	16.583	2403.6484	2420.2318	---	---
11G	Ant1	2437	16.663	2428.5684	2445.2318	---	---
11G	Ant2	2437	16.623	2428.6084	2445.2318	---	---
11G	Ant1	2462	16.783	2453.5285	2470.3117	---	---
11G	Ant2	2462	16.583	2453.6484	2470.2318	---	---
11N20MIMO	Ant1	2412	17.582	2403.1688	2420.7512	---	---
11N20MIMO	Ant2	2412	17.582	2403.1688	2420.7512	---	---
11N20MIMO	Ant1	2437	17.542	2428.1688	2445.7113	---	---
11N20MIMO	Ant2	2437	17.502	2428.2088	2445.7113	---	---
11N20MIMO	Ant1	2462	17.662	2453.0889	2470.7512	---	---
11N20MIMO	Ant2	2462	17.542	2453.1289	2470.6713	---	---
11N40MIMO	Ant1	2422	35.884	2403.9381	2439.8222	---	---
11N40MIMO	Ant2	2422	35.804	2404.0979	2439.9021	---	---
11N40MIMO	Ant1	2437	36.044	2418.8581	2454.9021	---	---
11N40MIMO	Ant2	2437	35.804	2419.0979	2454.9021	---	---
11N40MIMO	Ant1	2452	35.964	2434.0180	2469.9820	---	---
11N40MIMO	Ant2	2452	35.884	2434.0180	2469.9021	---	---
11AX20MIMO	Ant1	2412	18.422	2402.6893	2421.1109	---	---
11AX20MIMO	Ant2	2412	18.422	2402.7293	2421.1508	---	---
11AX20MIMO	Ant1	2437	18.462	2427.7293	2446.1908	---	---
11AX20MIMO	Ant2	2437	18.501	2427.7692	2446.2707	---	---
11AX20MIMO	Ant1	2462	18.422	2452.7293	2471.1508	---	---
11AX20MIMO	Ant2	2462	18.701	2452.5694	2471.2707	---	---
11AX40MIMO	Ant1	2422	36.843	2403.3786	2440.2218	---	---
11AX40MIMO	Ant2	2422	37.003	2403.6184	2440.6214	---	---
11AX40MIMO	Ant1	2437	37.003	2418.2987	2455.3017	---	---
11AX40MIMO	Ant2	2437	37.003	2418.4585	2455.4615	---	---
11AX40MIMO	Ant1	2452	36.923	2433.2987	2470.2218	---	---
11AX40MIMO	Ant2	2452	37.083	2433.6184	2470.7013	---	---


Test Graphs

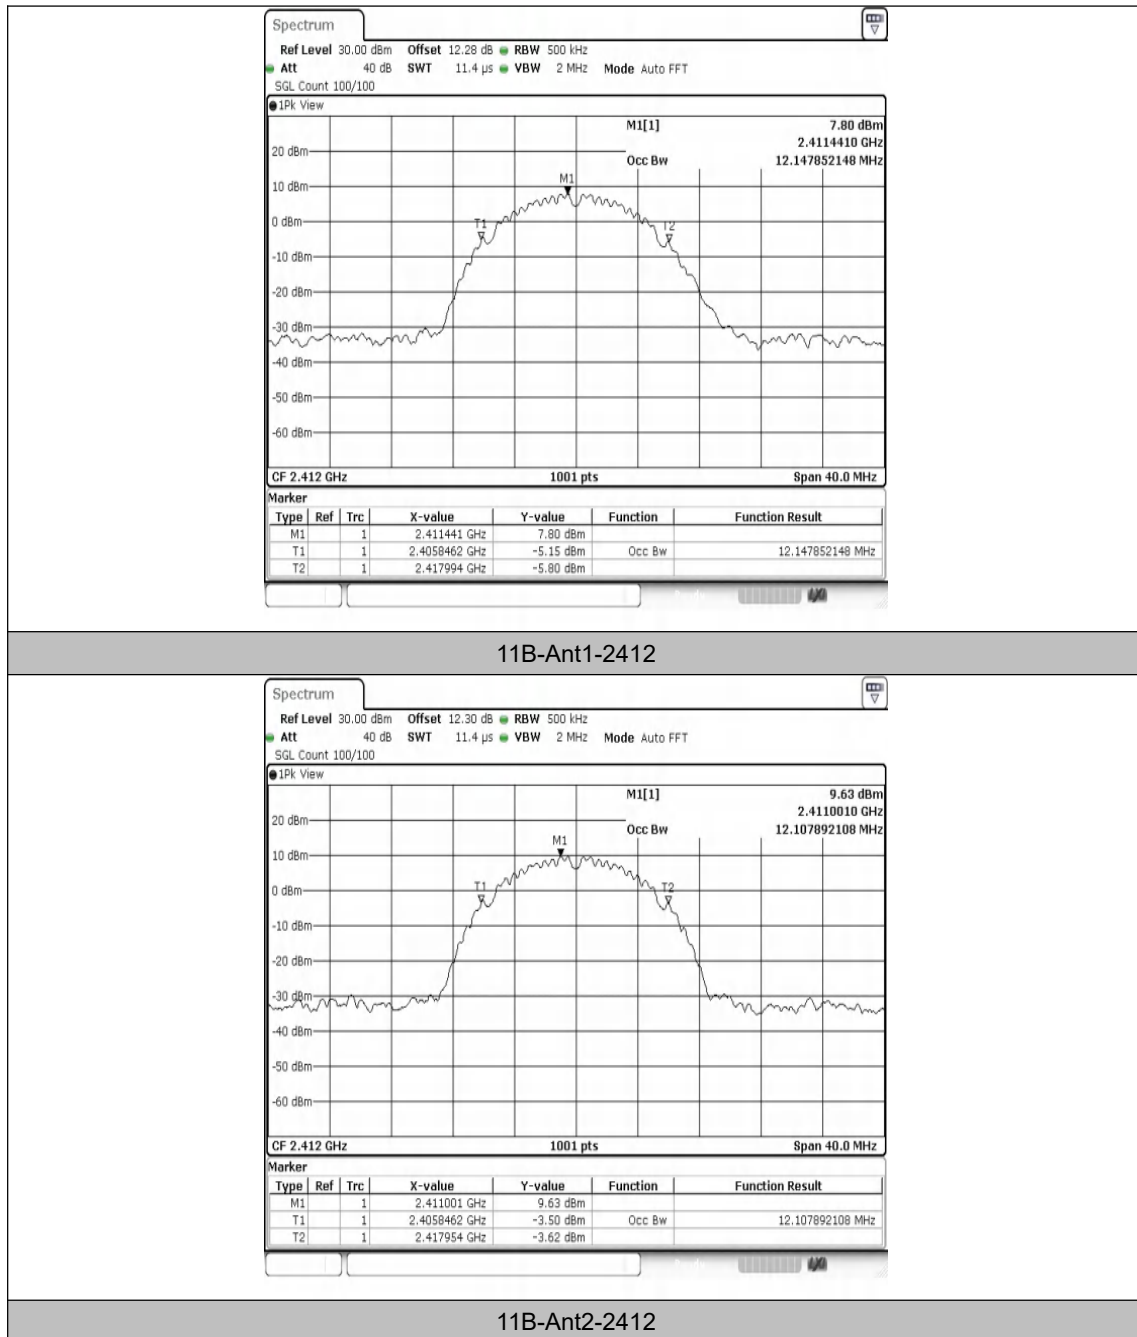



Shenzhen Anbotech Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotech.com E-mail: service@anbotech.com

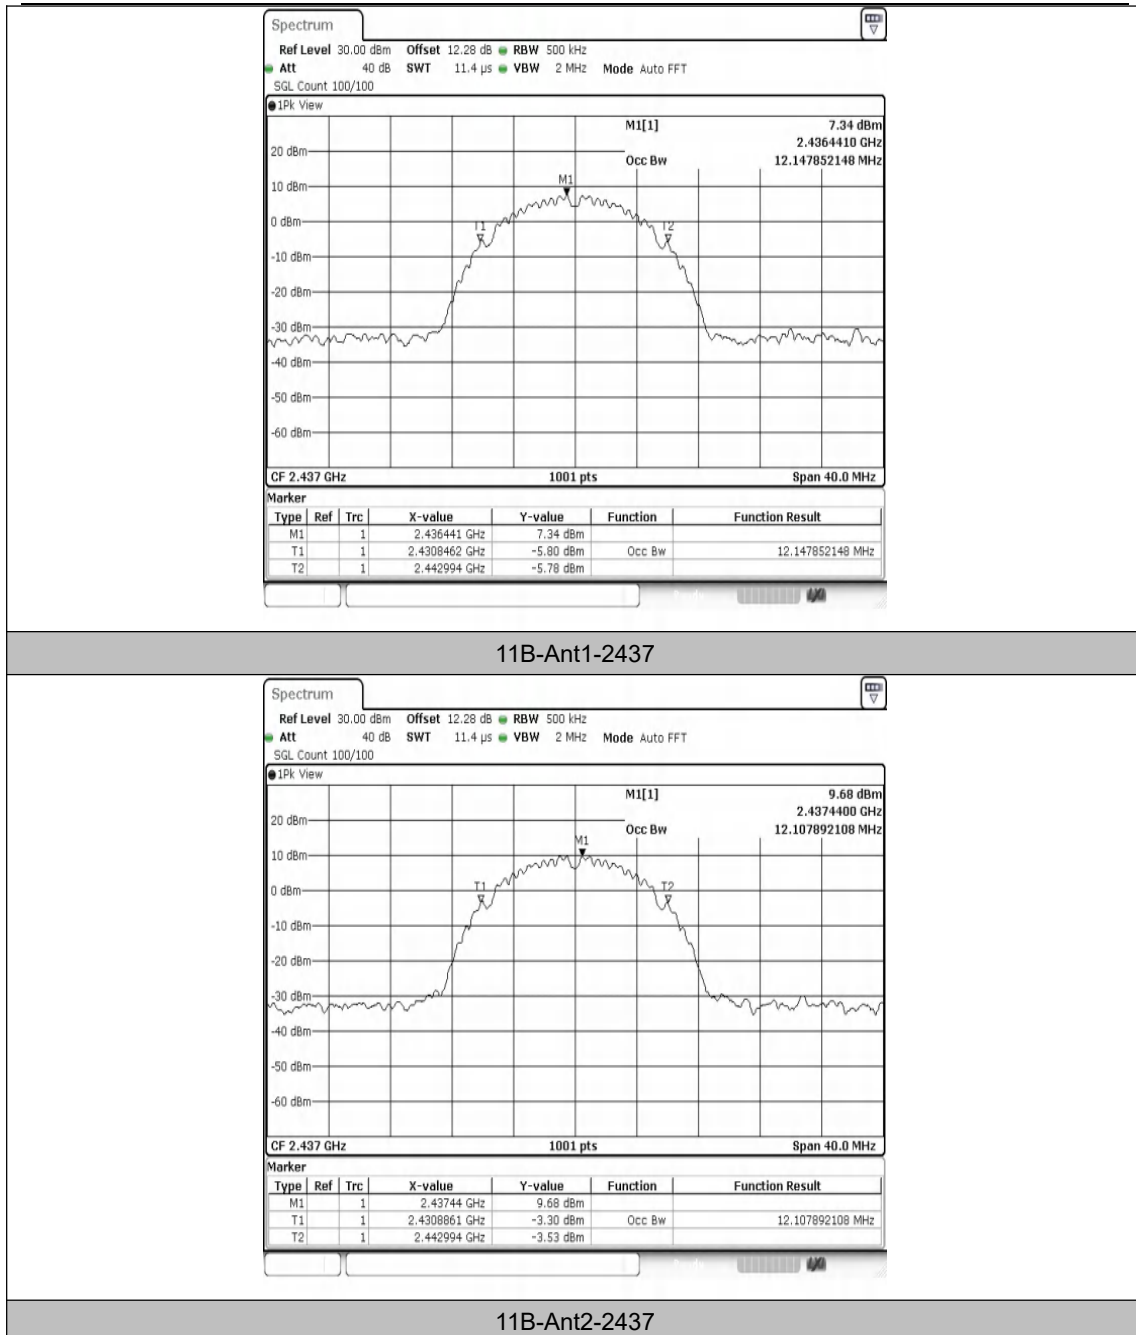

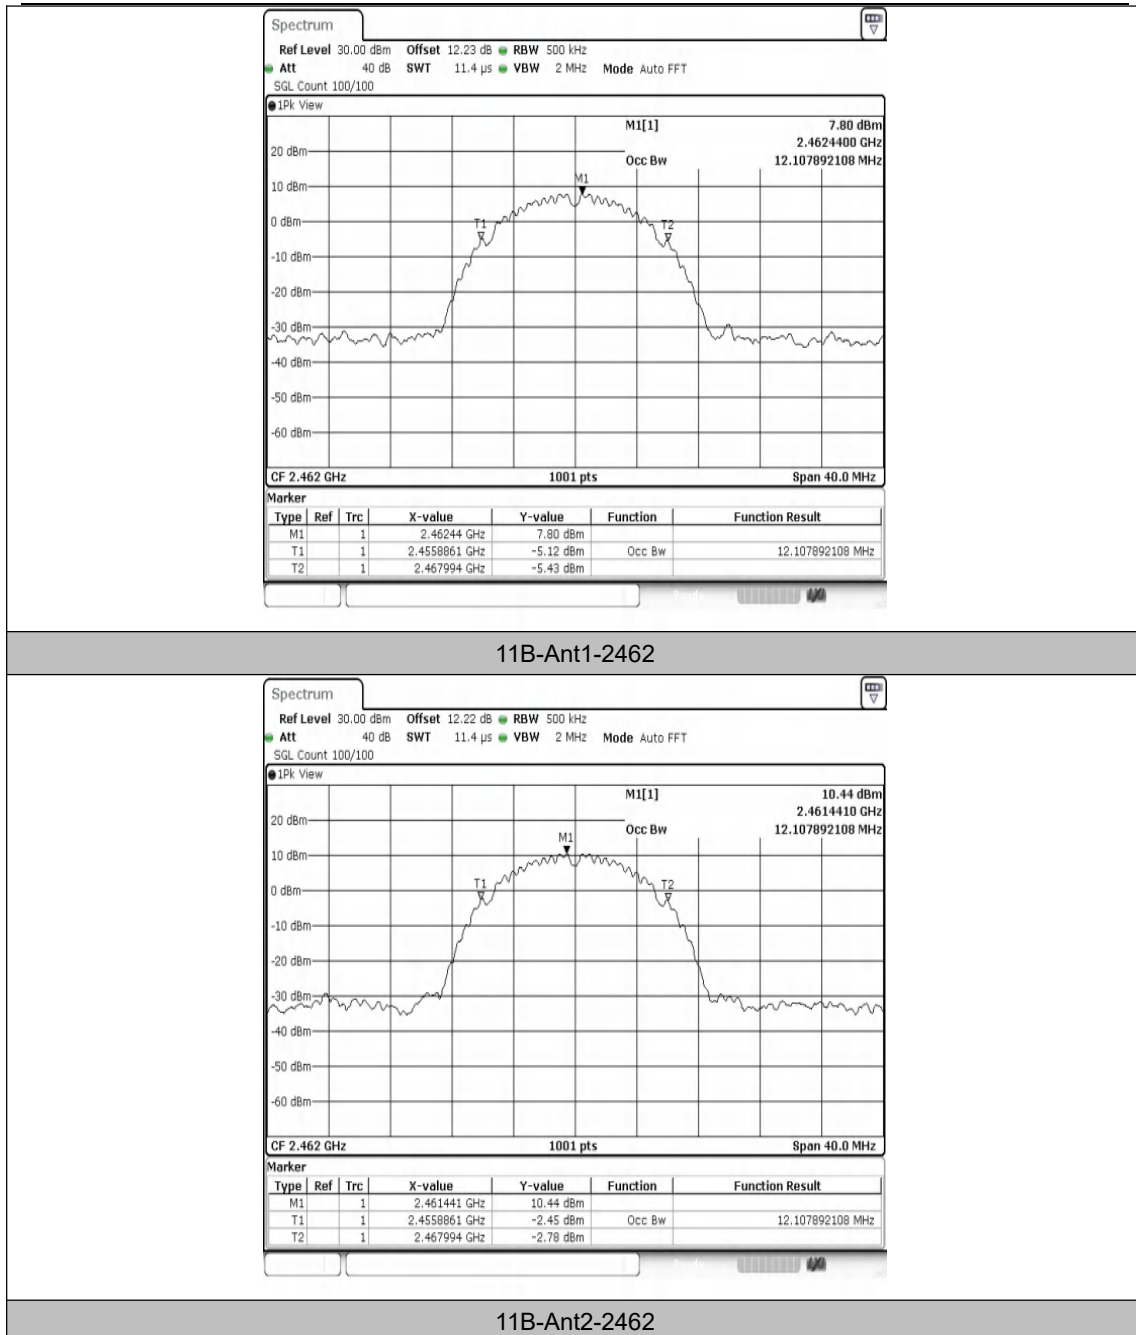


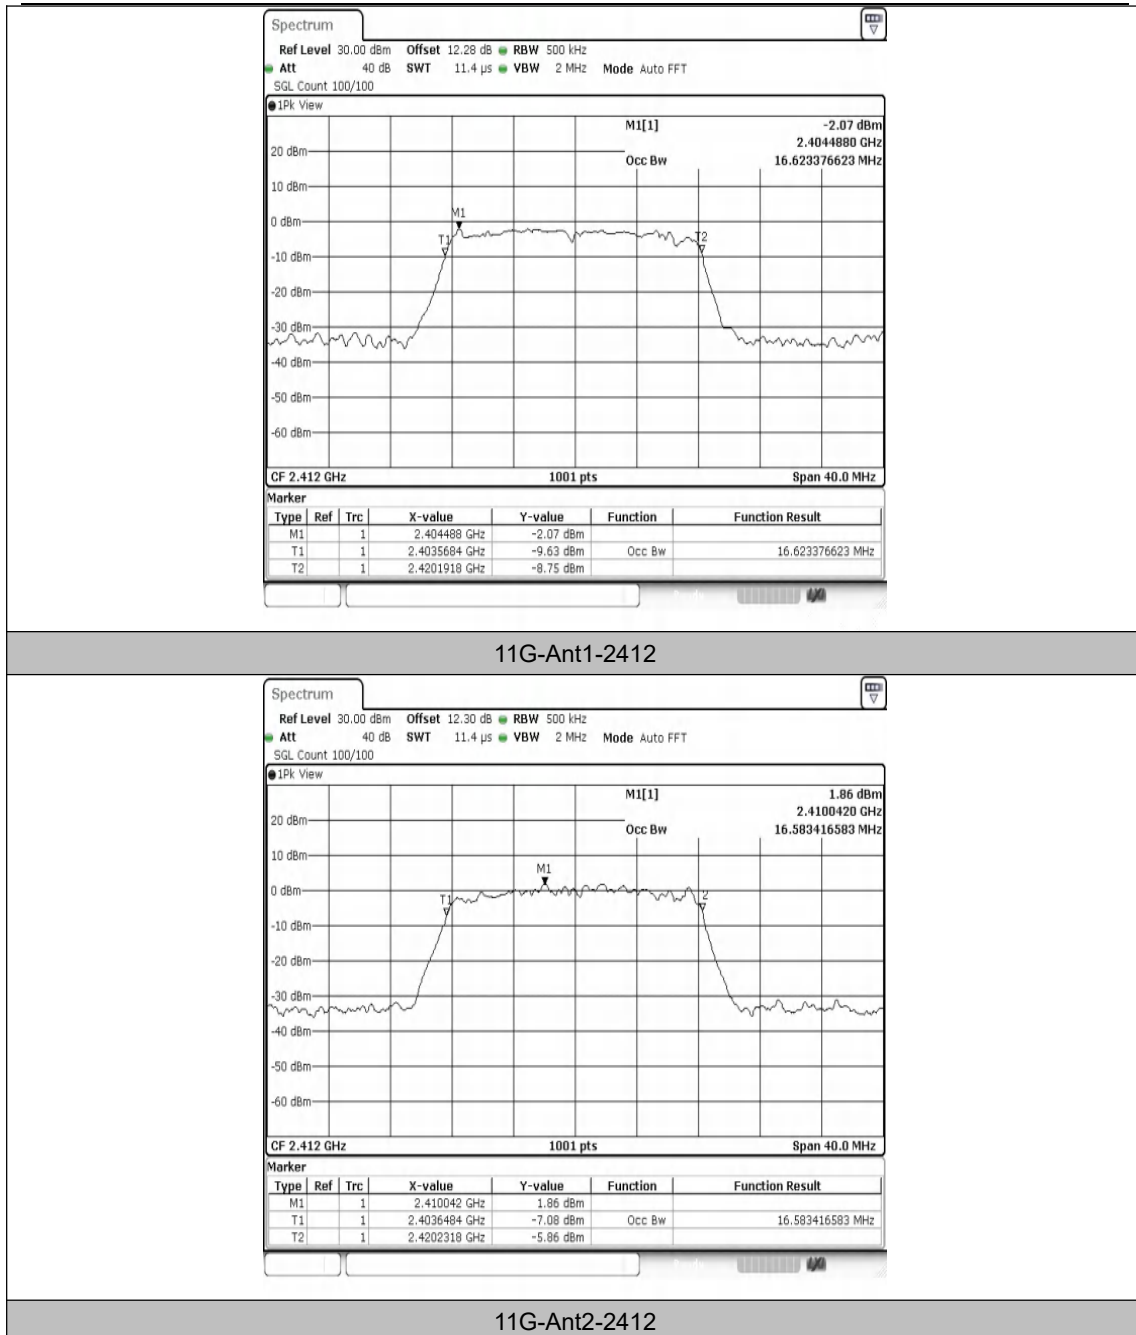

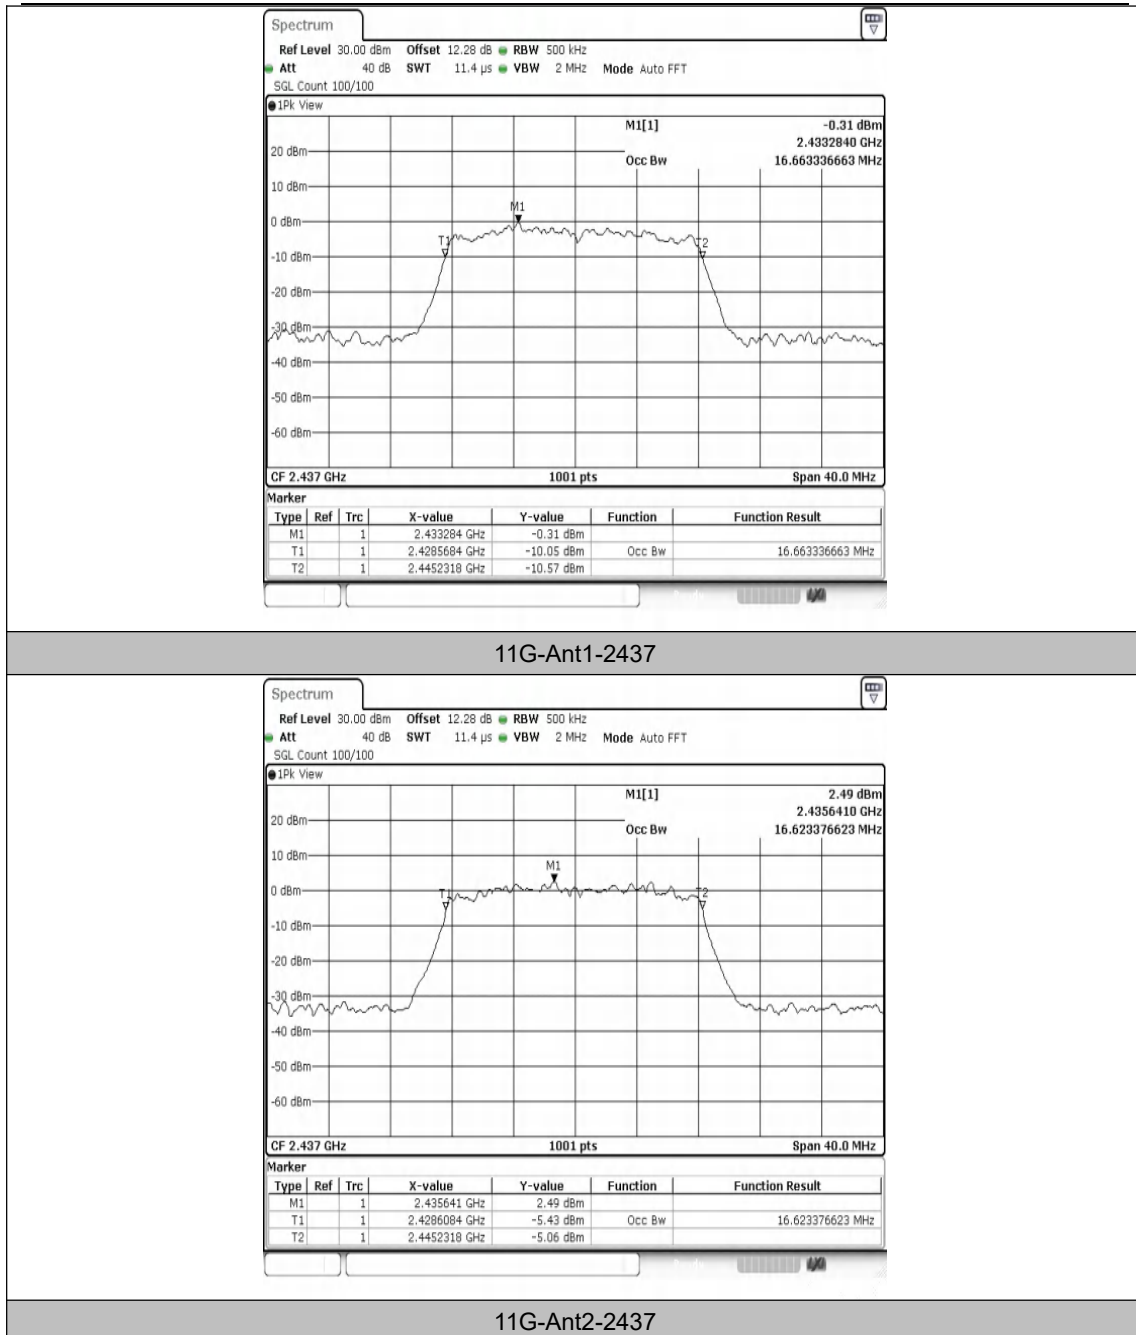


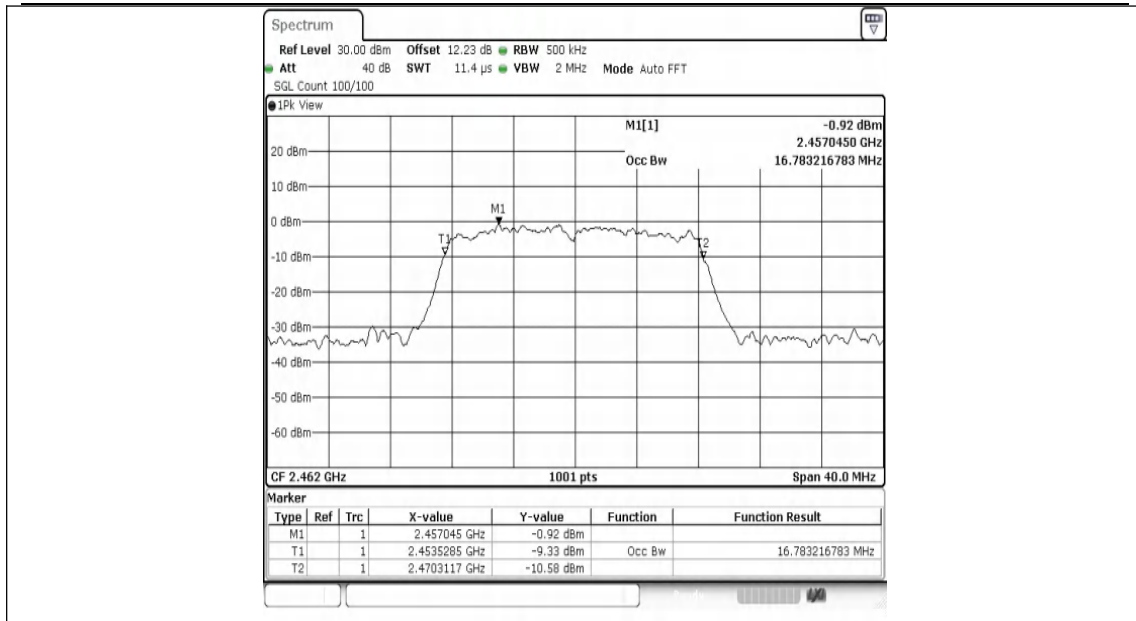


11G-Ant1-2462

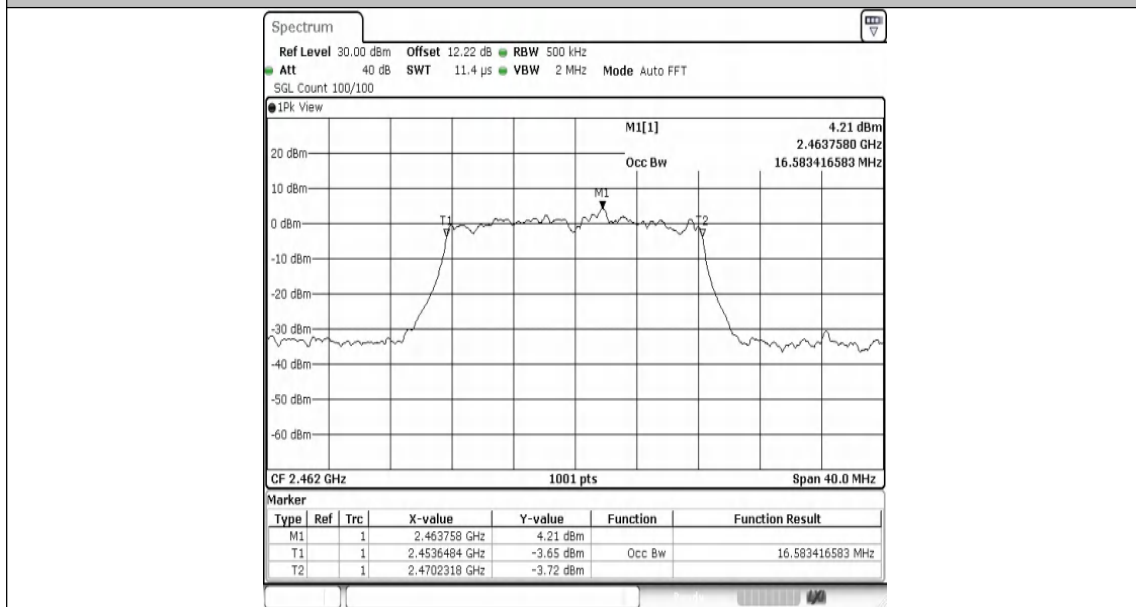


11G-Ant2-2462

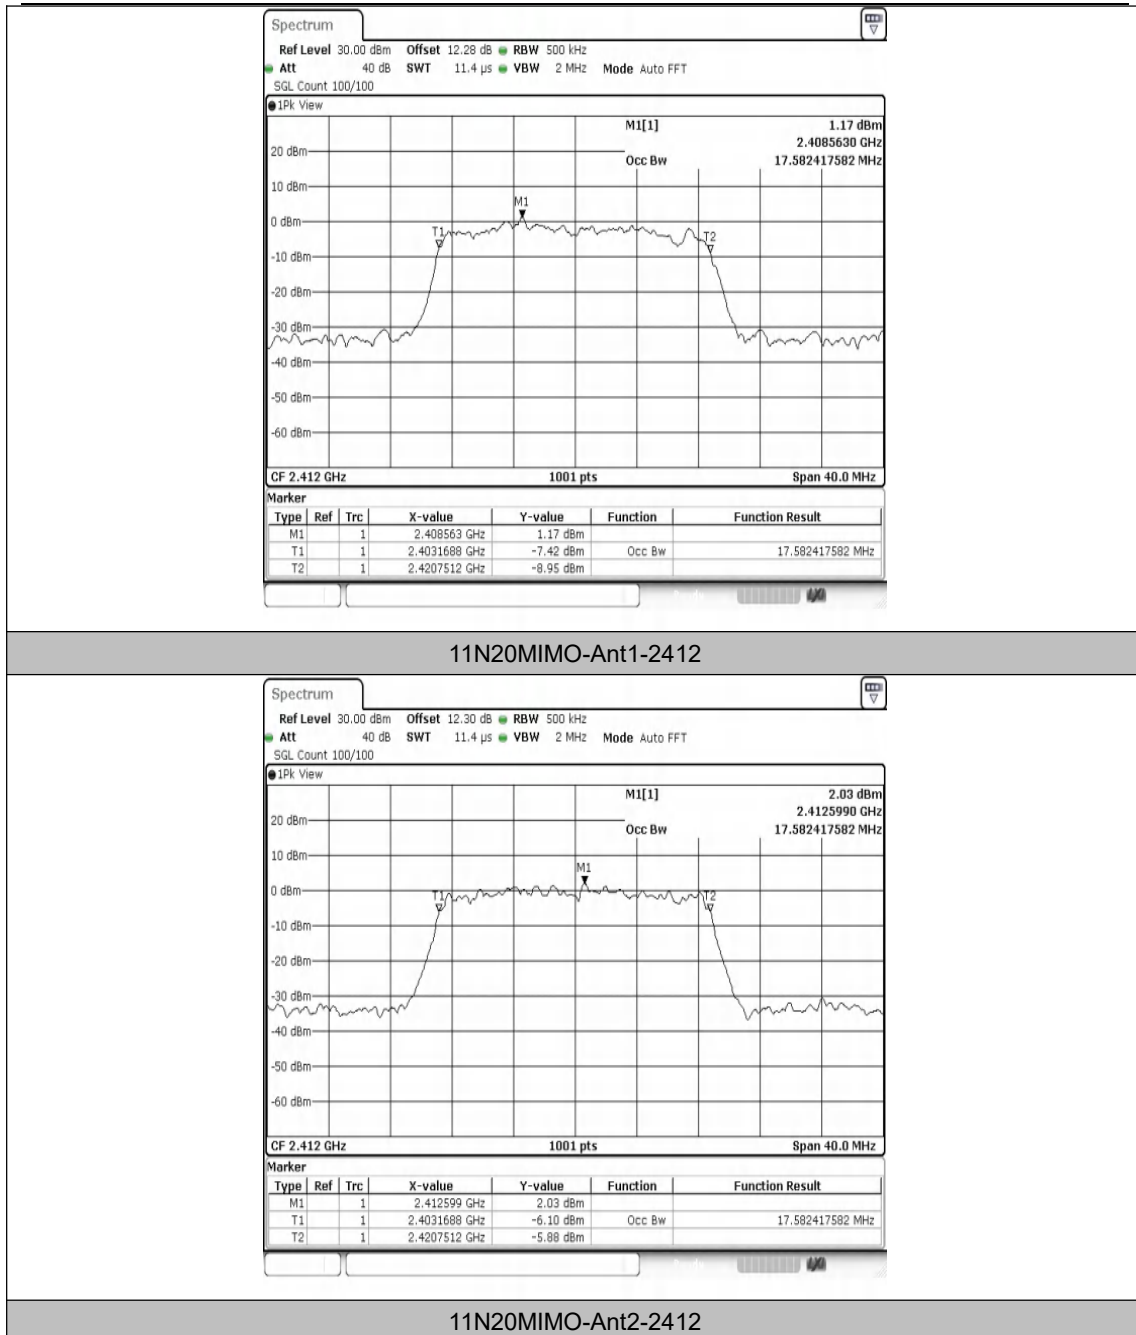


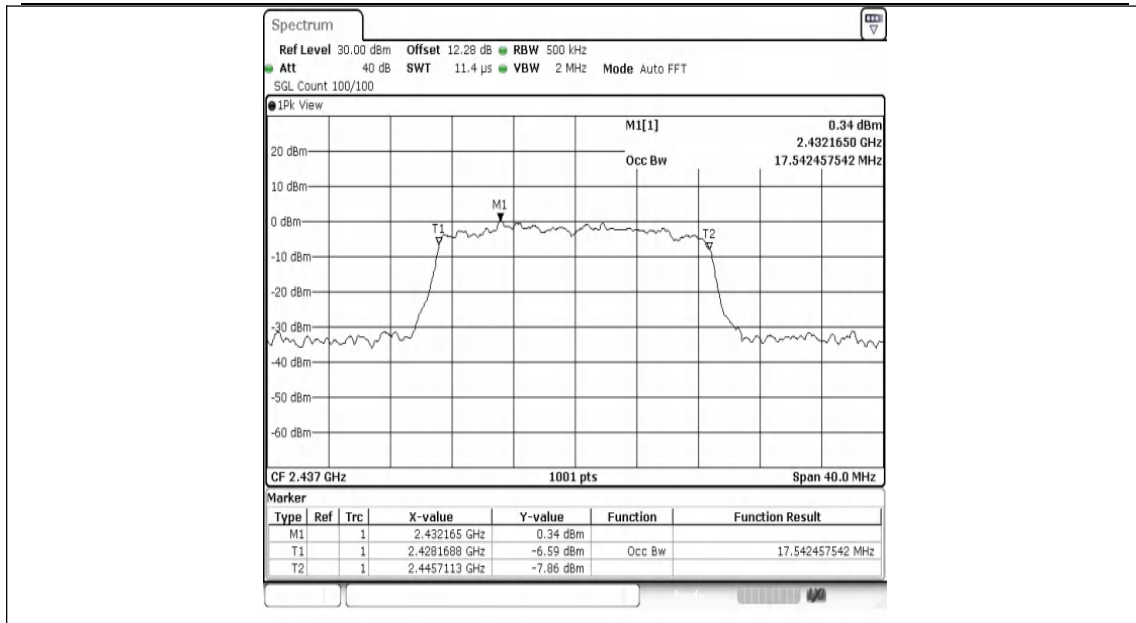



11N20MIMO-Ant1-2437

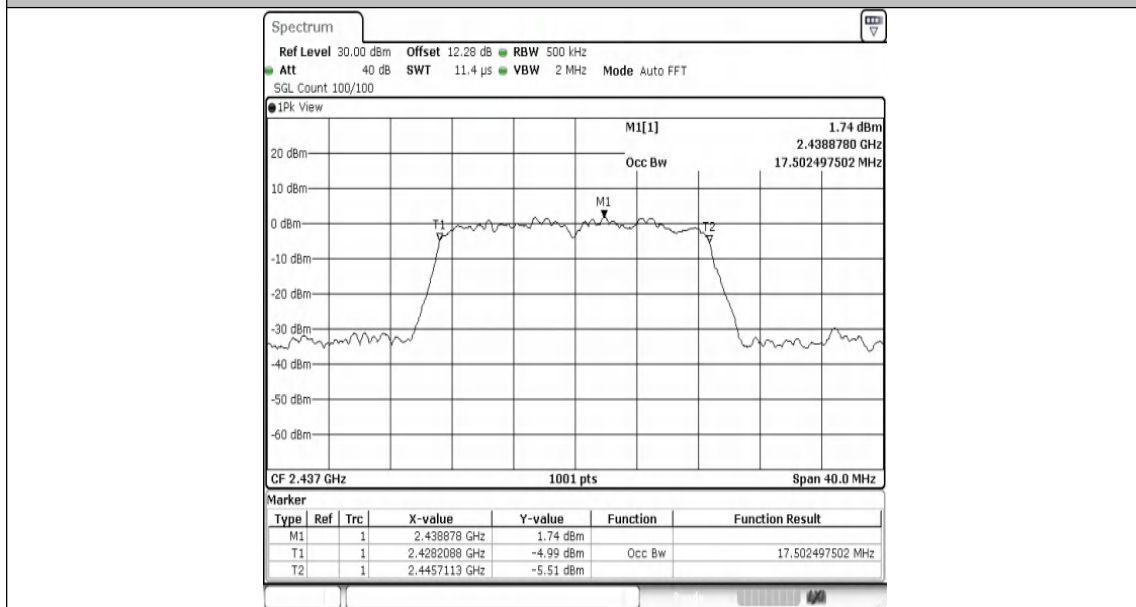


11N20MIMO-Ant2-2437

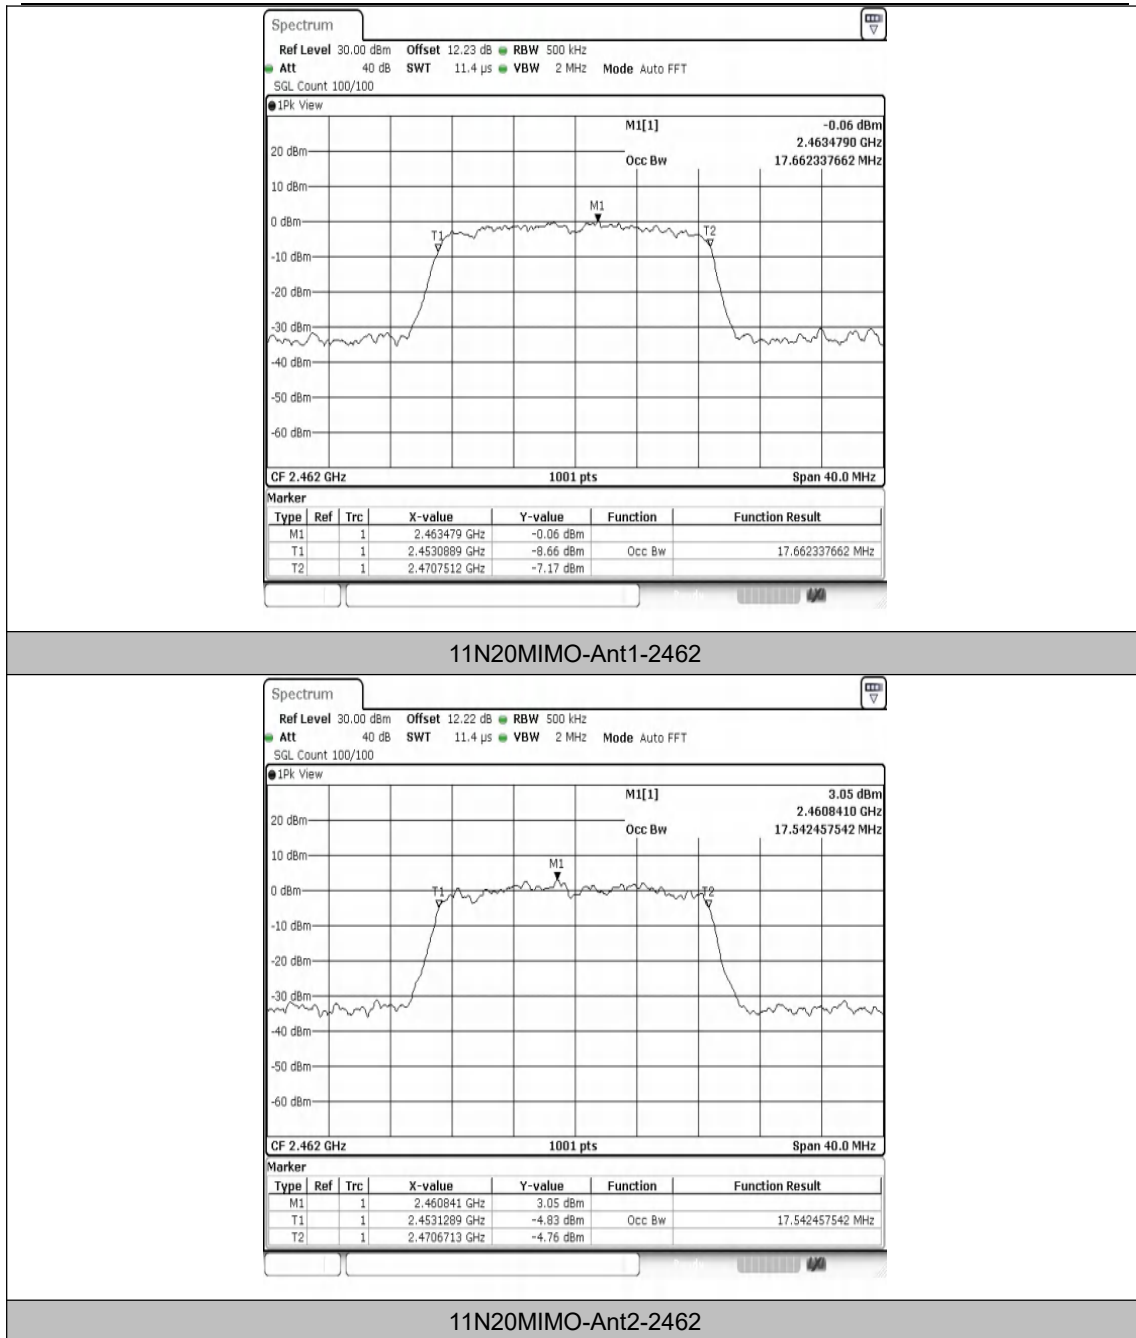

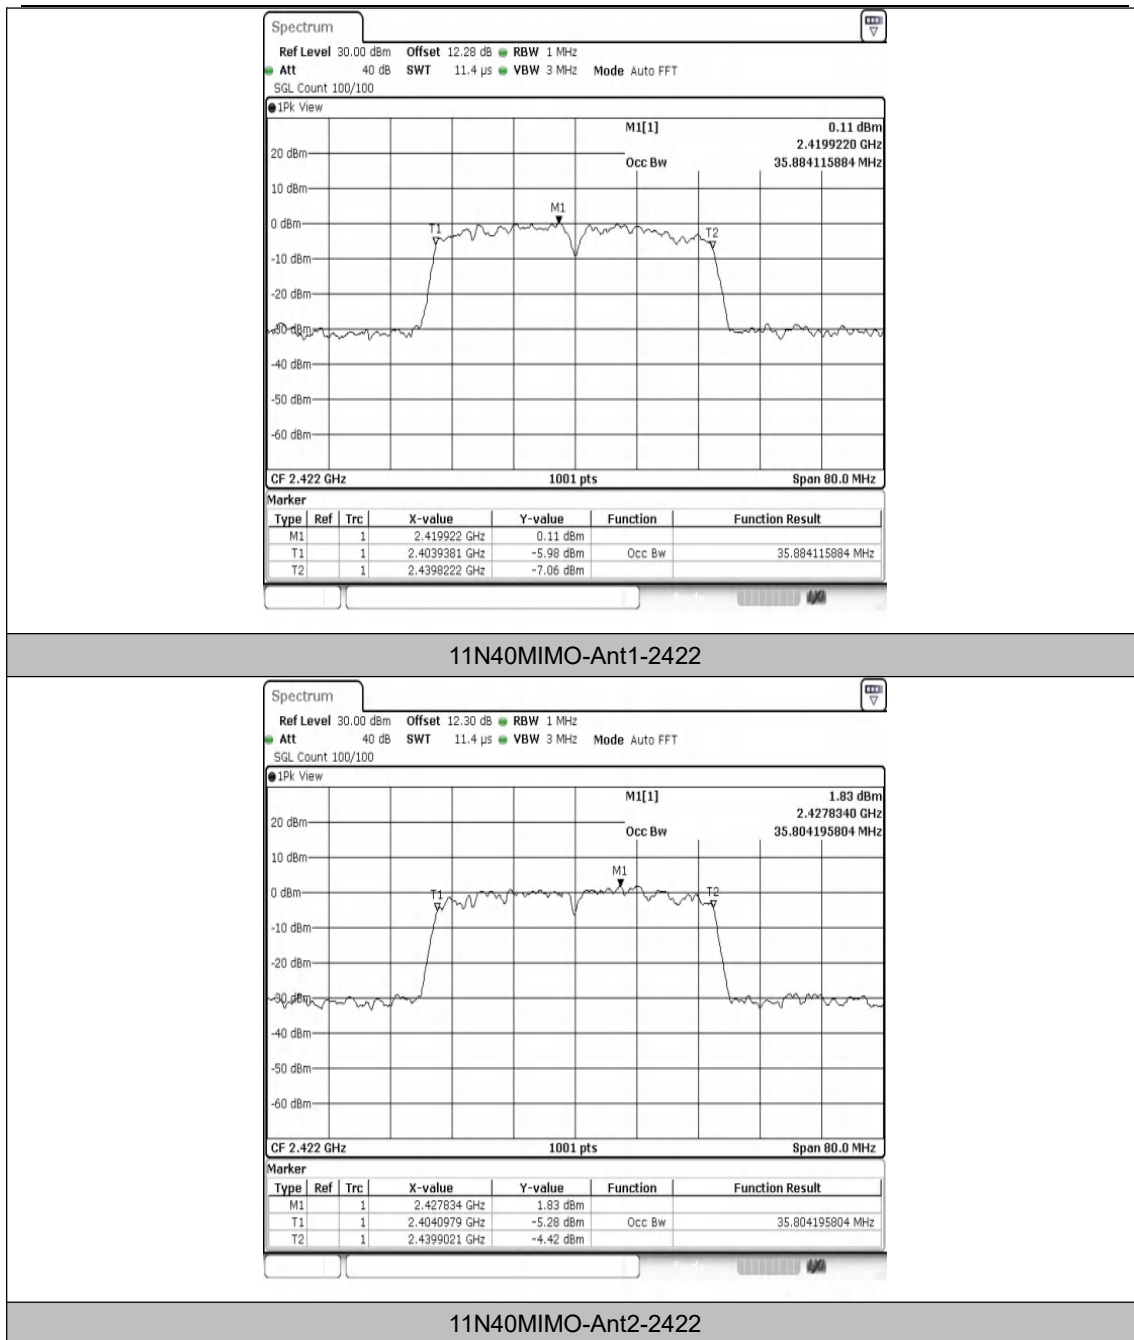

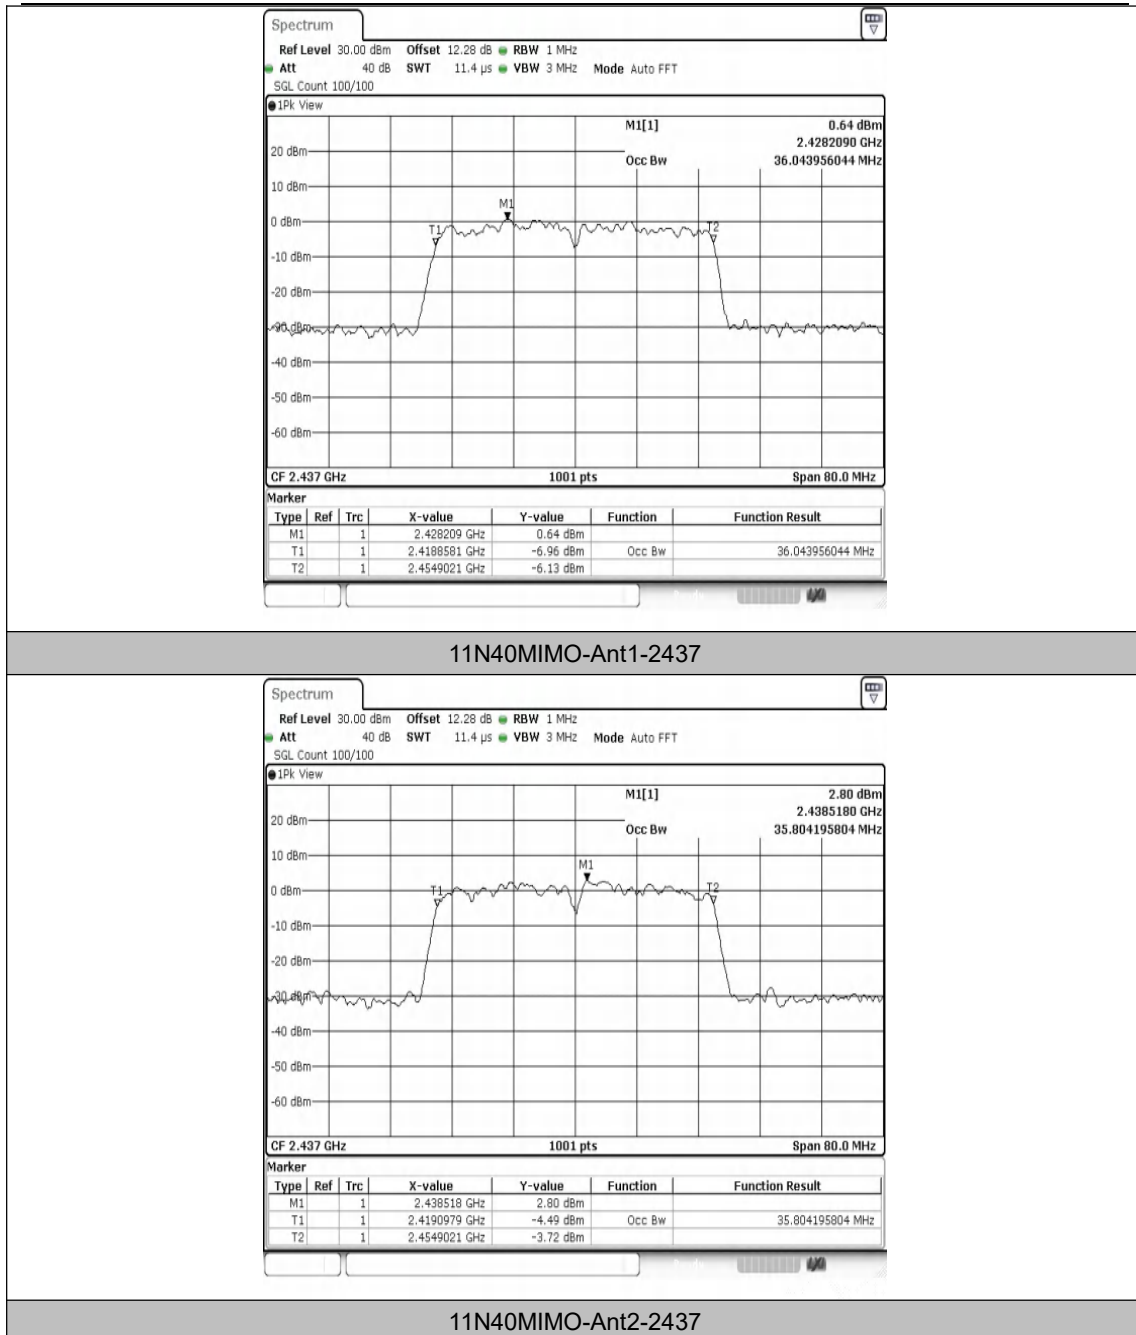


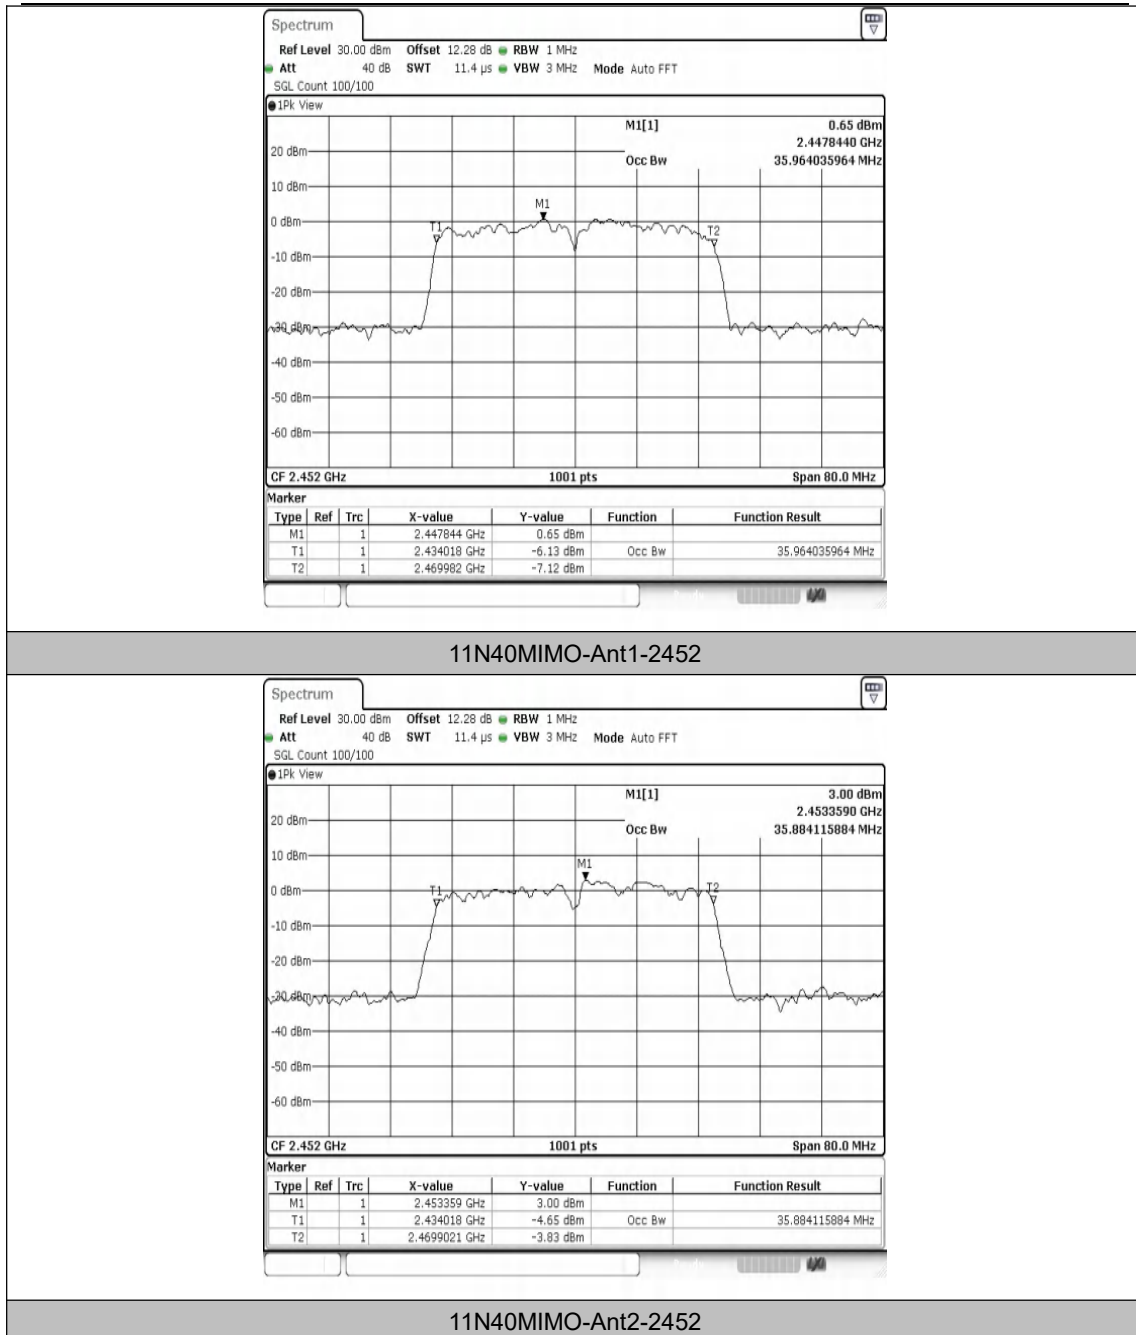



Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

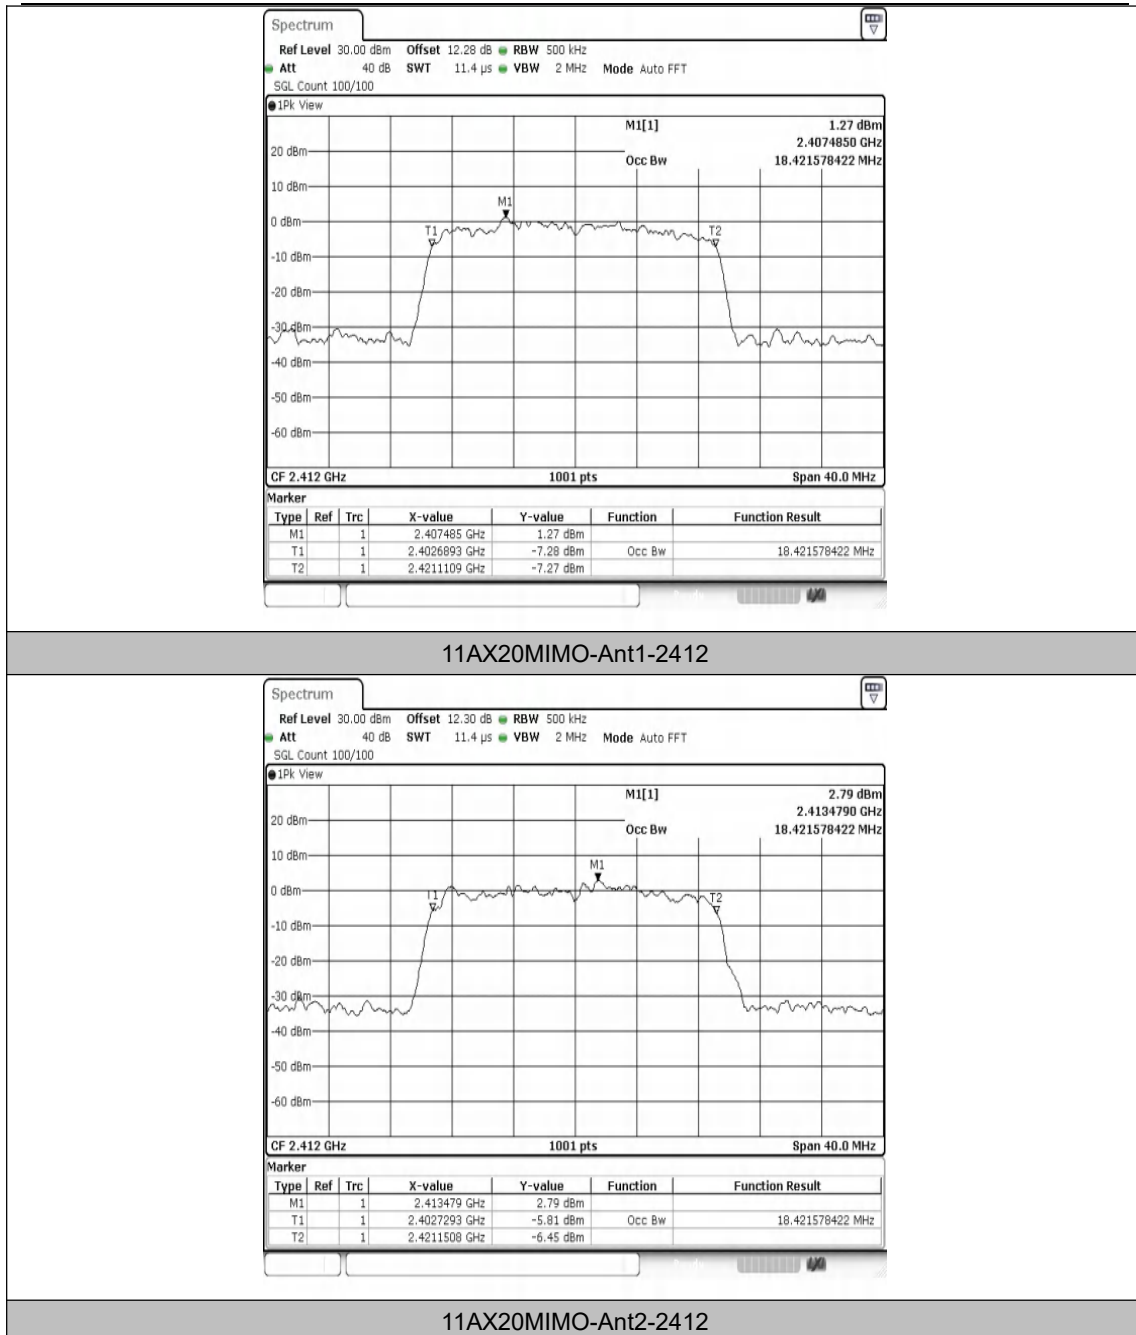


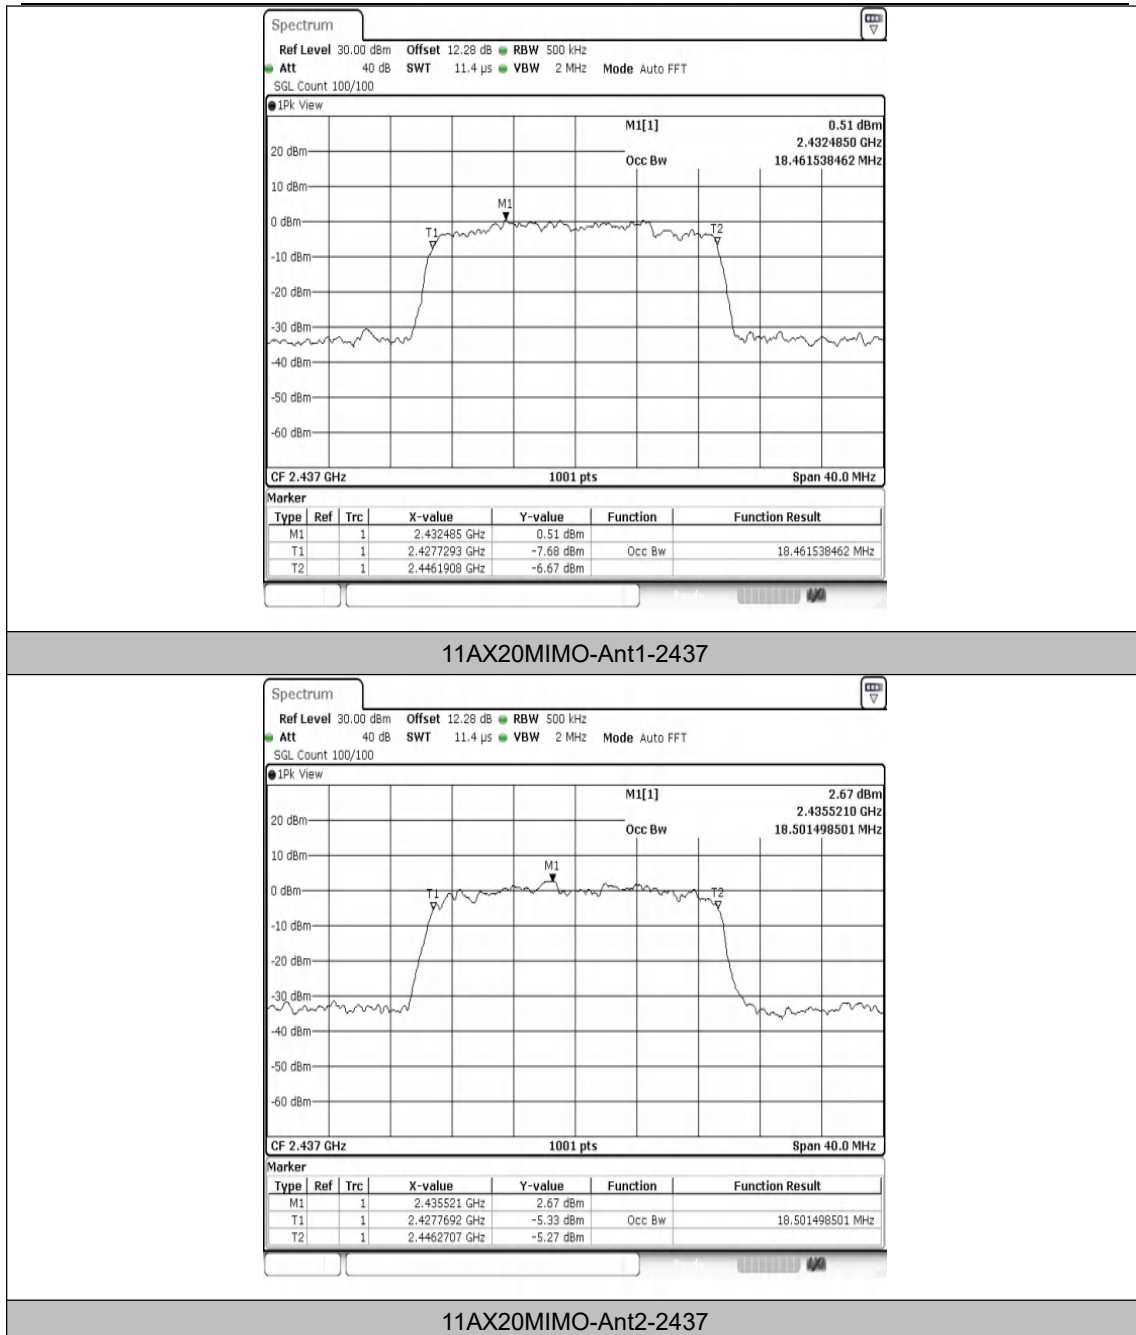

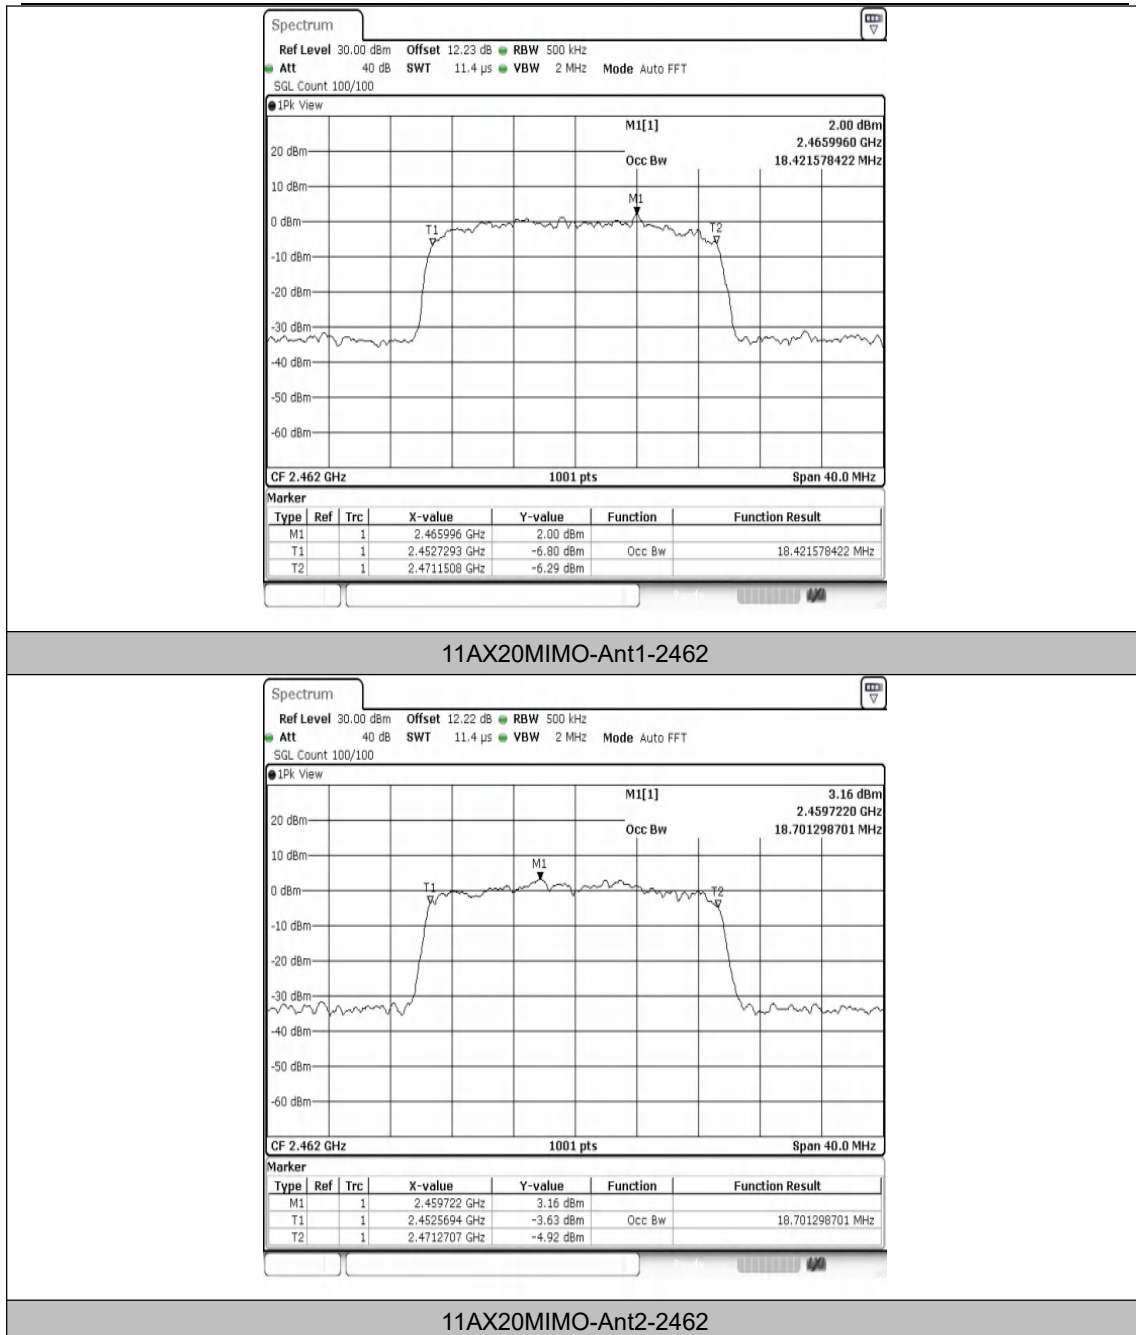

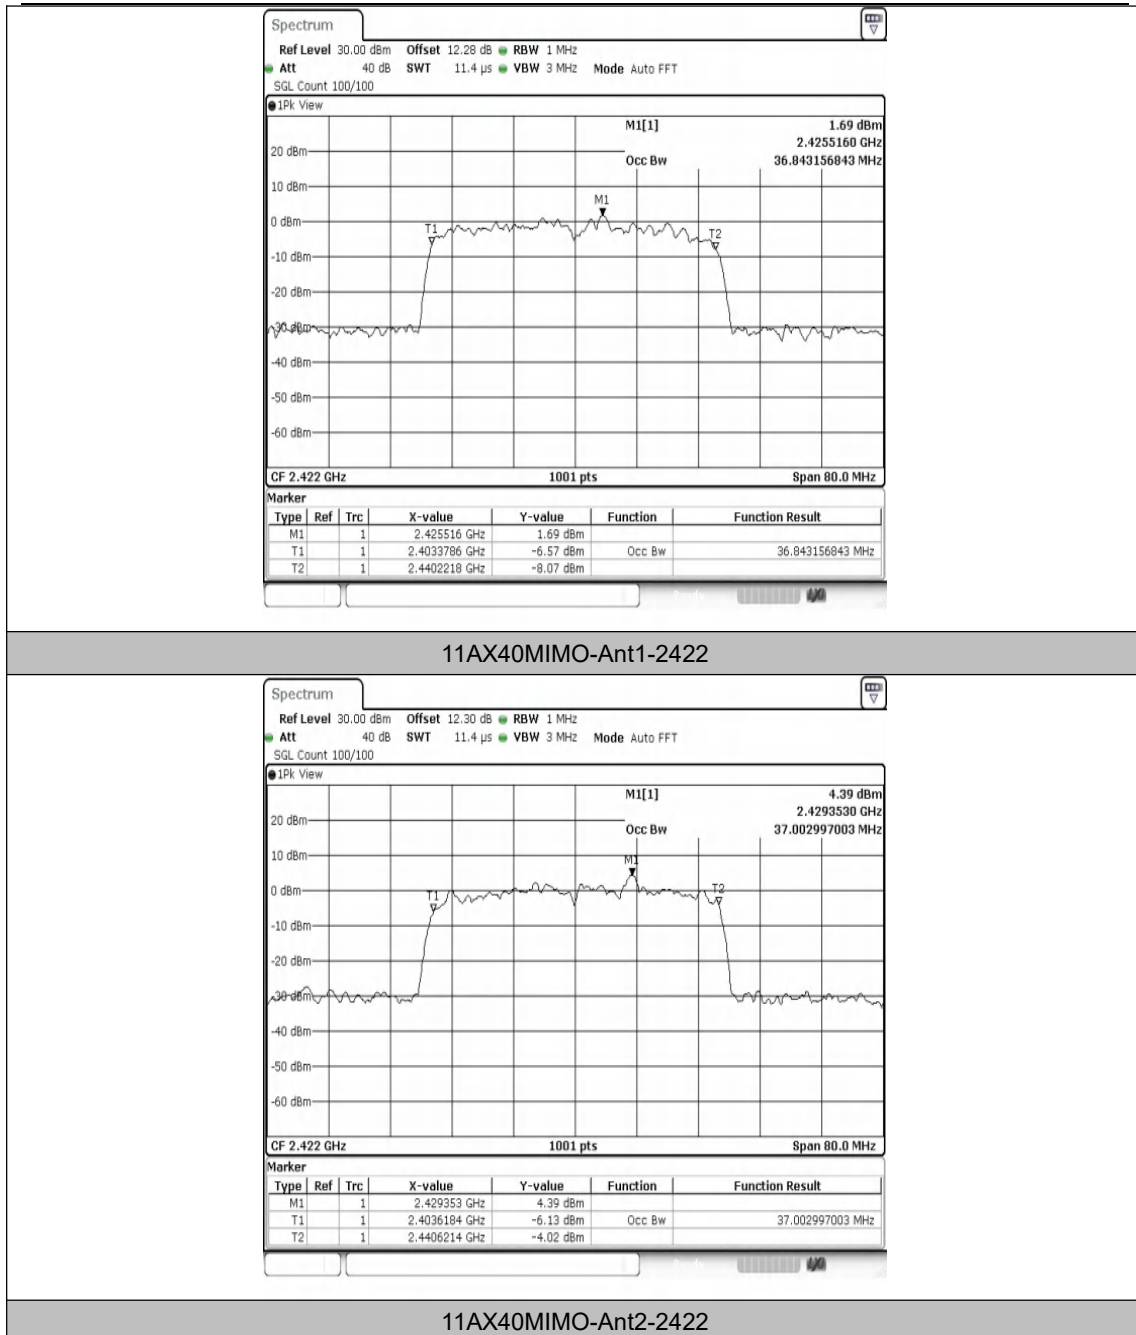

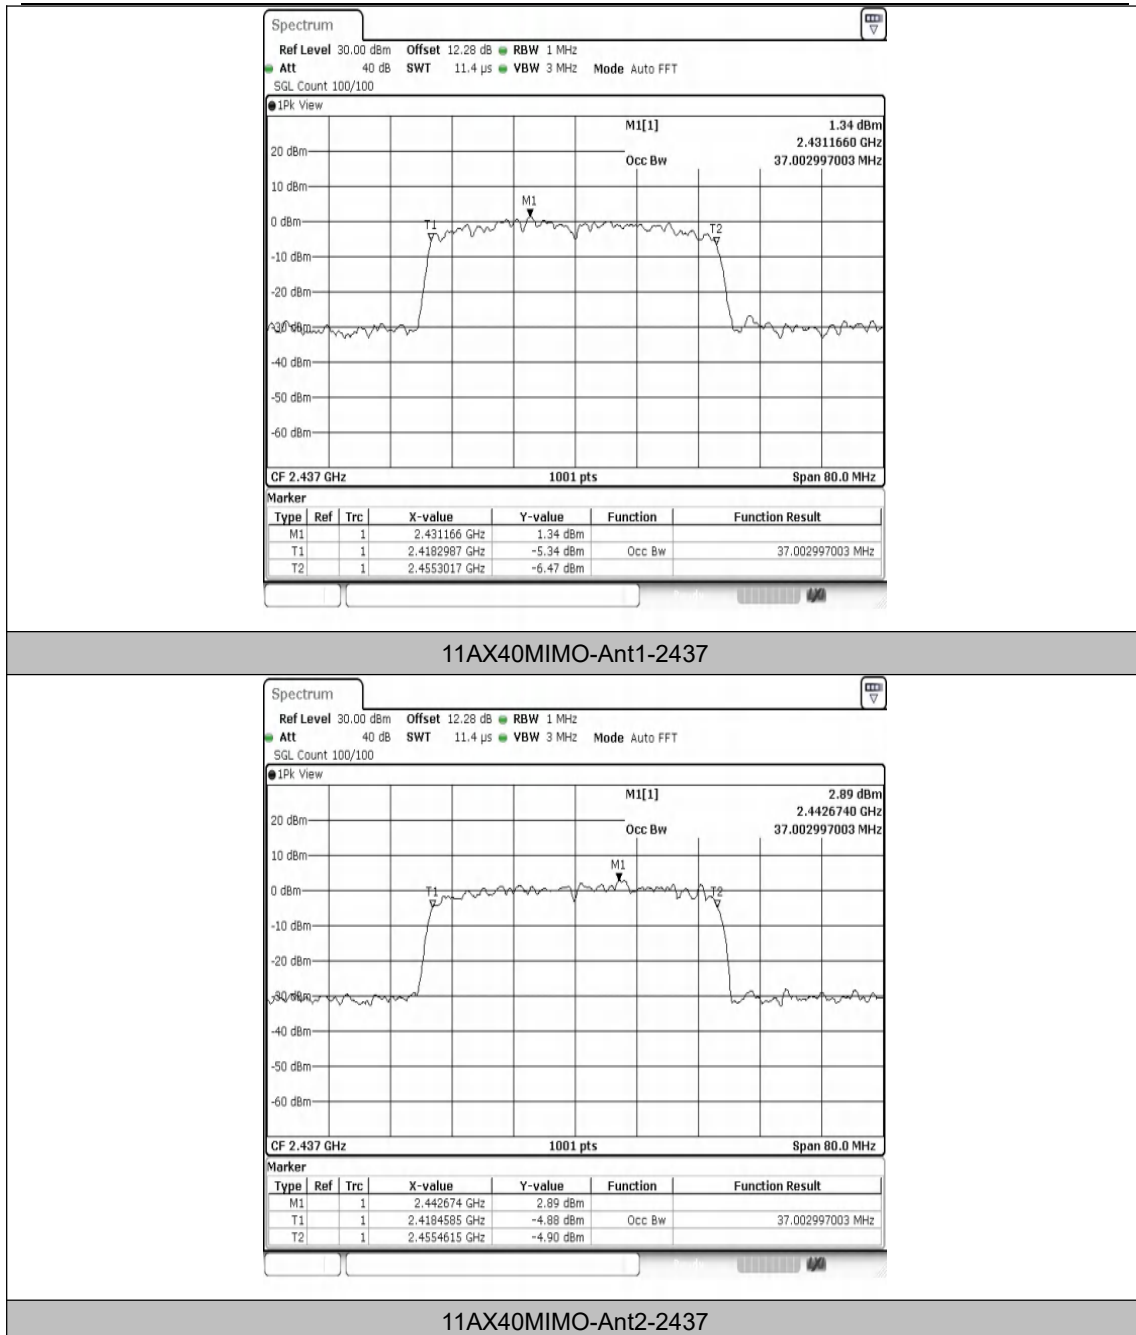

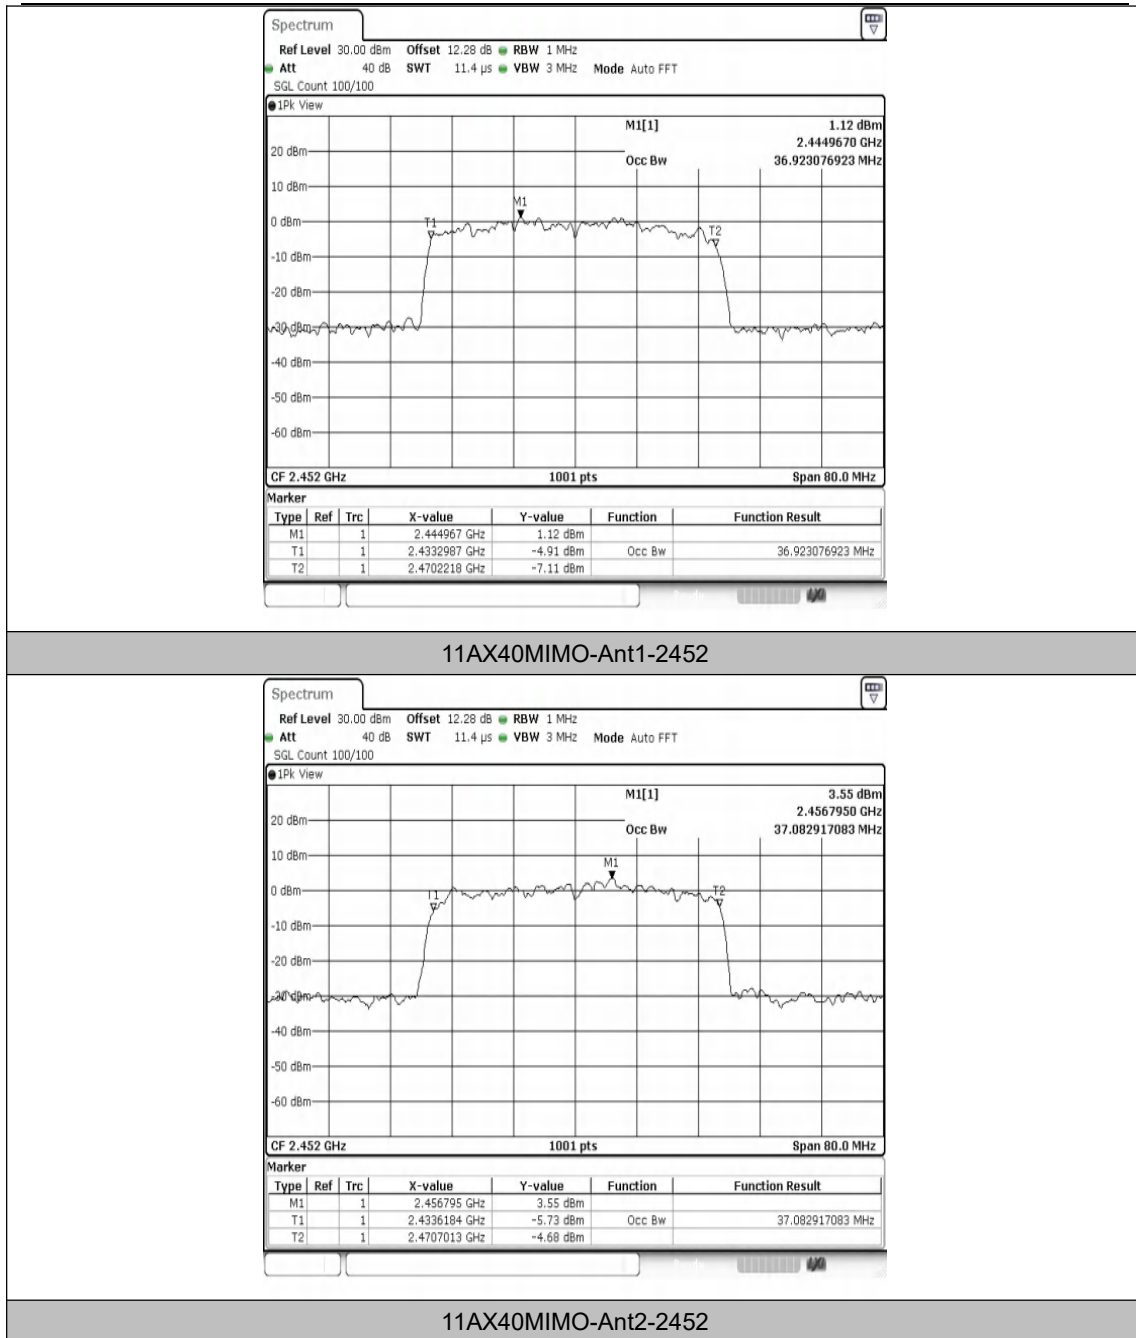

Appendix C: Maximum conducted output power

Test Result Average

Test Mode	Antenna	Frequency [MHz]	Average power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant1	2412	15.40	100.00	0.00	15.40	≤30.00	PASS
11B	Ant2	2412	17.28	100.00	0.00	17.28	≤30.00	PASS
11B	Ant1	2437	14.94	100.00	0.00	14.94	≤30.00	PASS
11B	Ant2	2437	17.36	100.00	0.00	17.36	≤30.00	PASS
11B	Ant1	2462	15.43	100.00	0.00	15.43	≤30.00	PASS
11B	Ant2	2462	18.12	100.00	0.00	18.12	≤30.00	PASS
11G	Ant1	2412	6.12	100.00	0.00	6.12	≤30.00	PASS
11G	Ant2	2412	8.52	100.00	0.00	8.52	≤30.00	PASS
11G	Ant1	2437	6.00	100.00	0.00	6.00	≤30.00	PASS
11G	Ant2	2437	8.91	100.00	0.00	8.91	≤30.00	PASS
11G	Ant1	2462	6.55	100.00	0.00	6.55	≤30.00	PASS
11G	Ant2	2462	9.47	100.00	0.00	9.47	≤30.00	PASS
11N20MIMO	Ant2	2412	8.38	100.00	0.00	8.38	≤30.00	PASS
11N20MIMO	Ant1	2412	7.00	100.00	0.00	7.00	≤30.00	PASS
11N20MIMO	total	2412	---	---	---	10.75	≤30.00	PASS
11N20MIMO	Ant1	2437	7.11	100.00	0.00	7.11	≤30.00	PASS
11N20MIMO	Ant2	2437	8.74	100.00	0.00	8.74	≤30.00	PASS
11N20MIMO	total	2437	---	---	---	11.01	≤30.00	PASS
11N20MIMO	Ant1	2462	7.66	100.00	0.00	7.66	≤30.00	PASS
11N20MIMO	Ant2	2462	9.30	100.00	0.00	9.30	≤30.00	PASS
11N20MIMO	total	2462	---	---	---	11.57	≤30.00	PASS
11N40MIMO	Ant1	2422	6.69	100.00	0.00	6.69	≤30.00	PASS
11N40MIMO	Ant2	2422	8.08	100.00	0.00	8.08	≤30.00	PASS
11N40MIMO	total	2422	---	---	---	10.45	≤30.00	PASS
11N40MIMO	Ant1	2437	7.37	100.00	0.00	7.37	≤30.00	PASS
11N40MIMO	Ant2	2437	8.85	100.00	0.00	8.85	≤30.00	PASS
11N40MIMO	total	2437	---	---	---	11.18	≤30.00	PASS
11N40MIMO	Ant1	2452	7.06	100.00	0.00	7.06	≤30.00	PASS
11N40MIMO	Ant2	2452	8.64	100.00	0.00	8.64	≤30.00	PASS
11N40MIMO	total	2452	---	---	---	10.93	≤30.00	PASS
11AX20MIMO	Ant2	2412	8.18	100.00	0.00	8.18	≤30.00	PASS
11AX20MIMO	total	2412	---	---	---	10.55	≤30.00	PASS
11AX20MIMO	Ant1	2412	6.79	100.00	0.00	6.79	≤30.00	PASS
11AX20MIMO	Ant1	2437	6.90	100.00	0.00	6.90	≤30.00	PASS
11AX20MIMO	Ant2	2437	8.56	100.00	0.00	8.56	≤30.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20MIMO	total	2437	---	---	---	10.82	≤30.00	PASS
11AX20MIMO	Ant1	2462	7.44	100.00	0.00	7.44	≤30.00	PASS
11AX20MIMO	Ant2	2462	9.10	100.00	0.00	9.10	≤30.00	PASS
11AX20MIMO	total	2462	---	---	---	11.36	≤30.00	PASS
11AX40MIMO	Ant1	2422	6.54	100.00	0.00	6.54	≤30.00	PASS
11AX40MIMO	Ant2	2422	7.95	100.00	0.00	7.95	≤30.00	PASS
11AX40MIMO	total	2422	---	---	---	10.31	≤30.00	PASS
11AX40MIMO	Ant1	2437	7.22	100.00	0.00	7.22	≤30.00	PASS
11AX40MIMO	Ant2	2437	8.72	100.00	0.00	8.72	≤30.00	PASS
11AX40MIMO	total	2437	---	---	---	11.04	≤30.00	PASS
11AX40MIMO	Ant1	2452	6.88	100.00	0.00	6.88	≤30.00	PASS
11AX40MIMO	Ant2	2452	8.51	100.00	0.00	8.51	≤30.00	PASS
11AX40MIMO	total	2452	---	---	---	10.78	≤30.00	PASS

Note: 1. The cable loss are compensated in the graph


Test Graphs Average

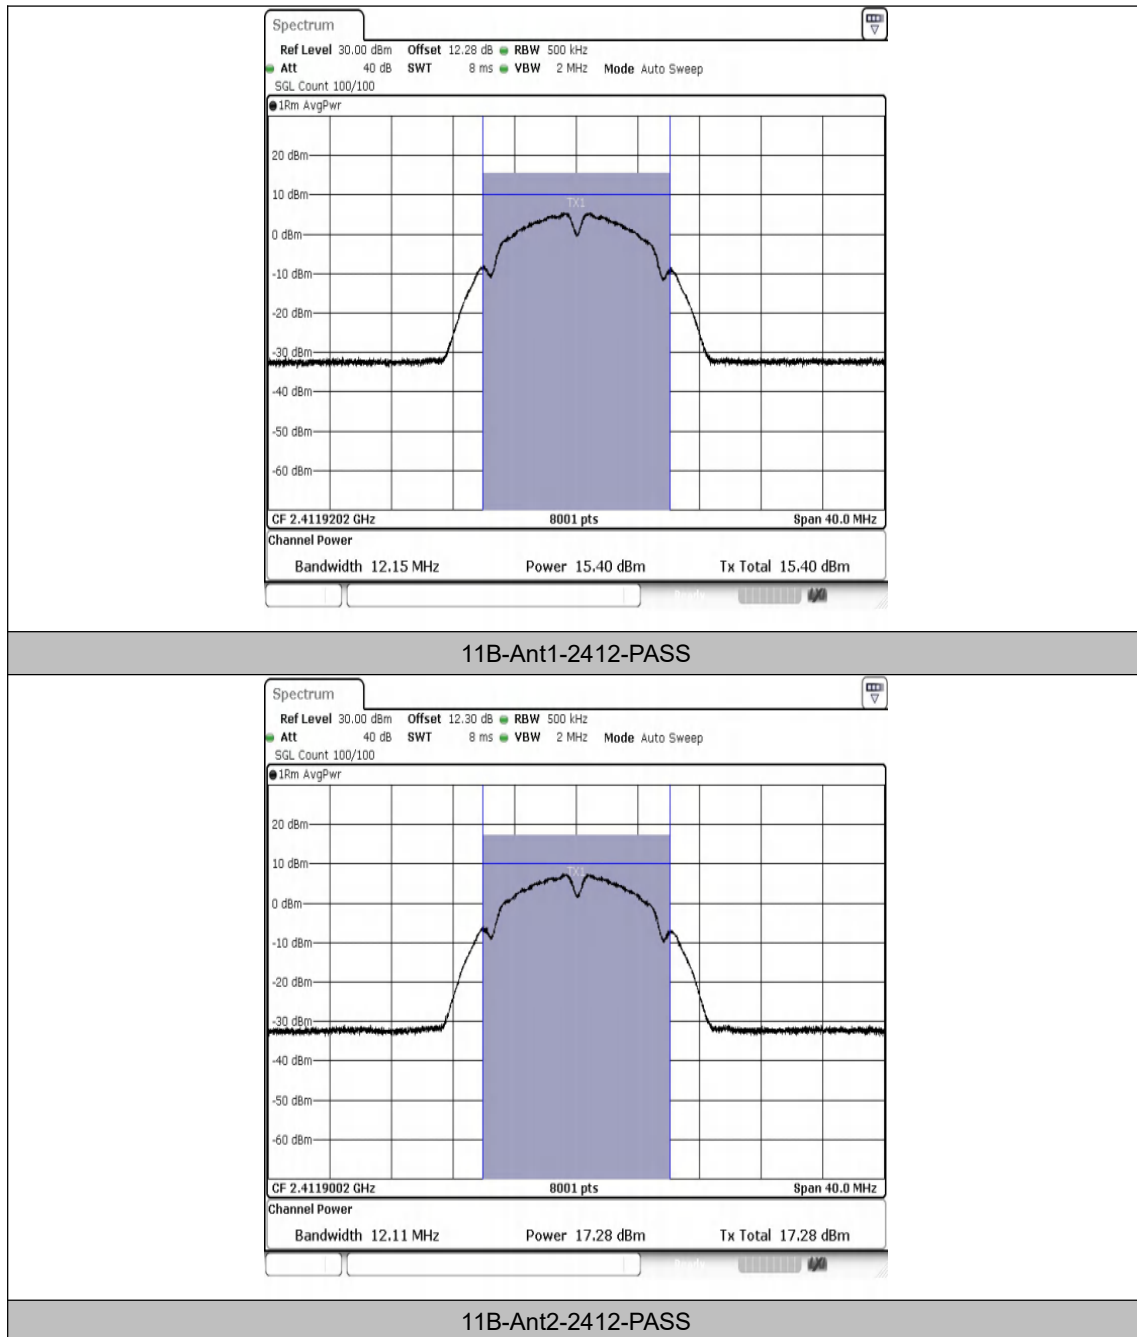

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

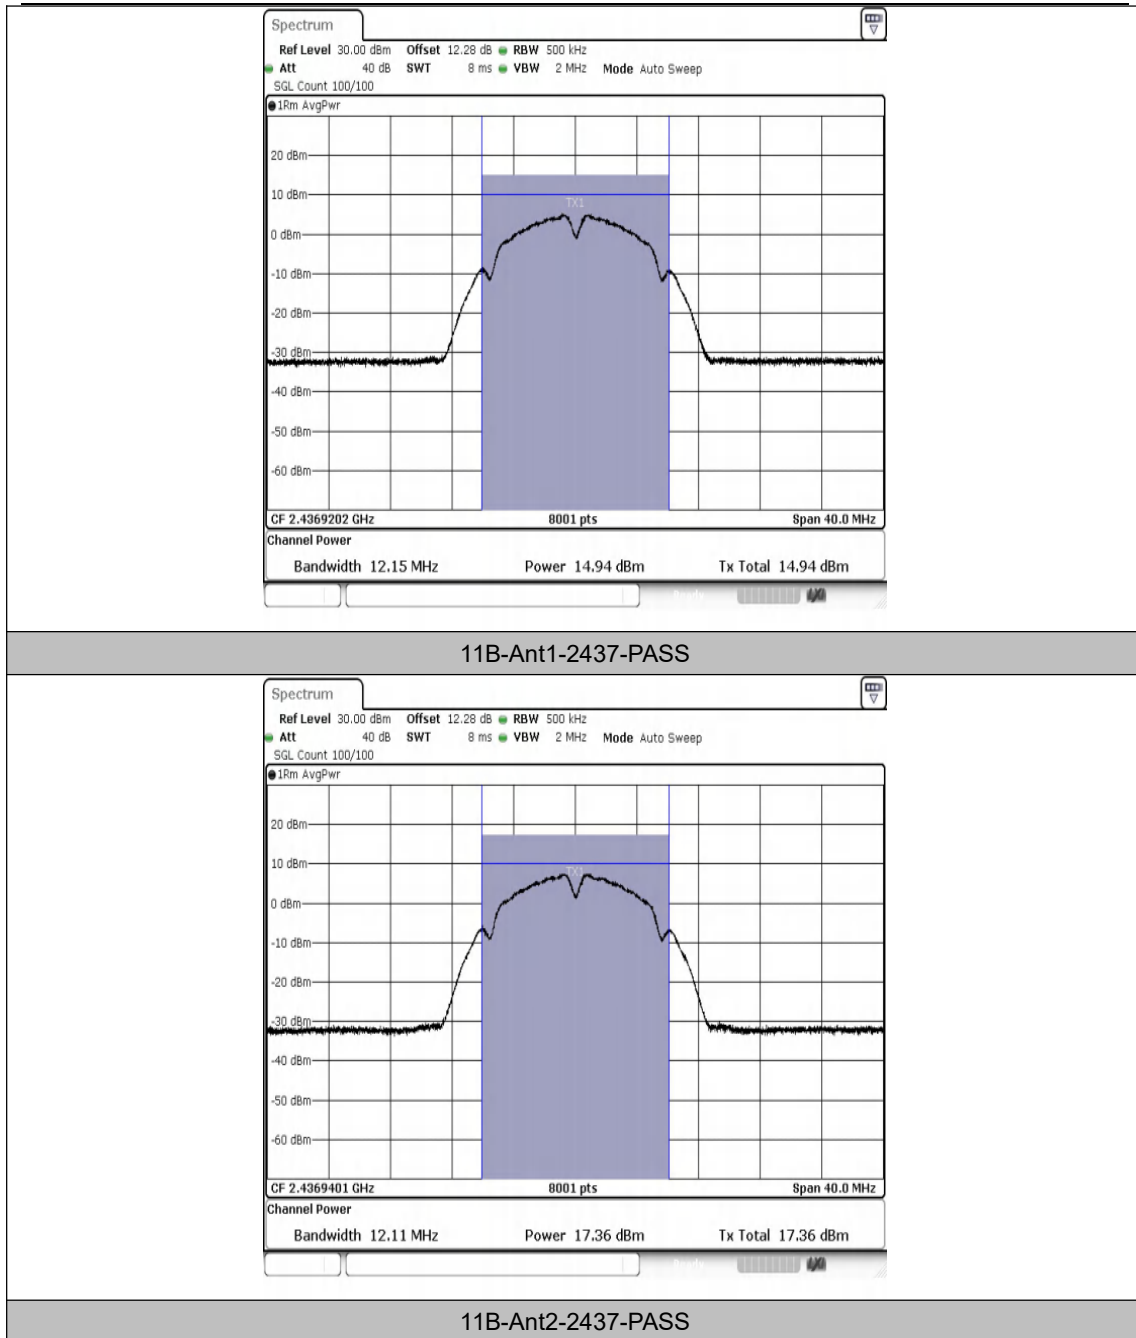

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

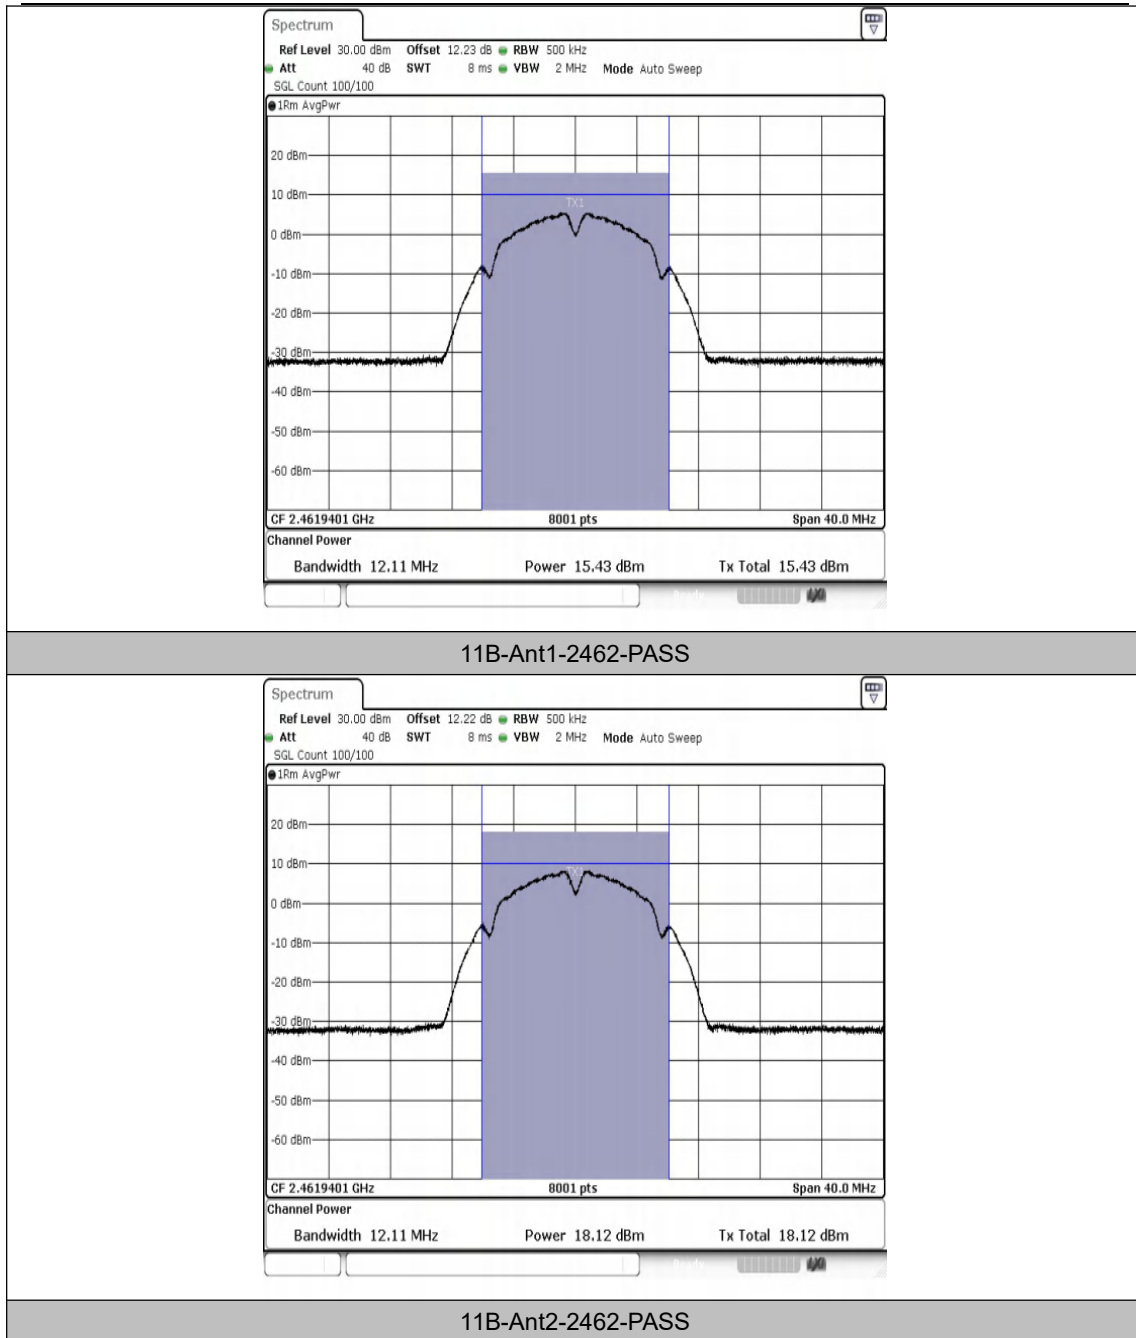

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

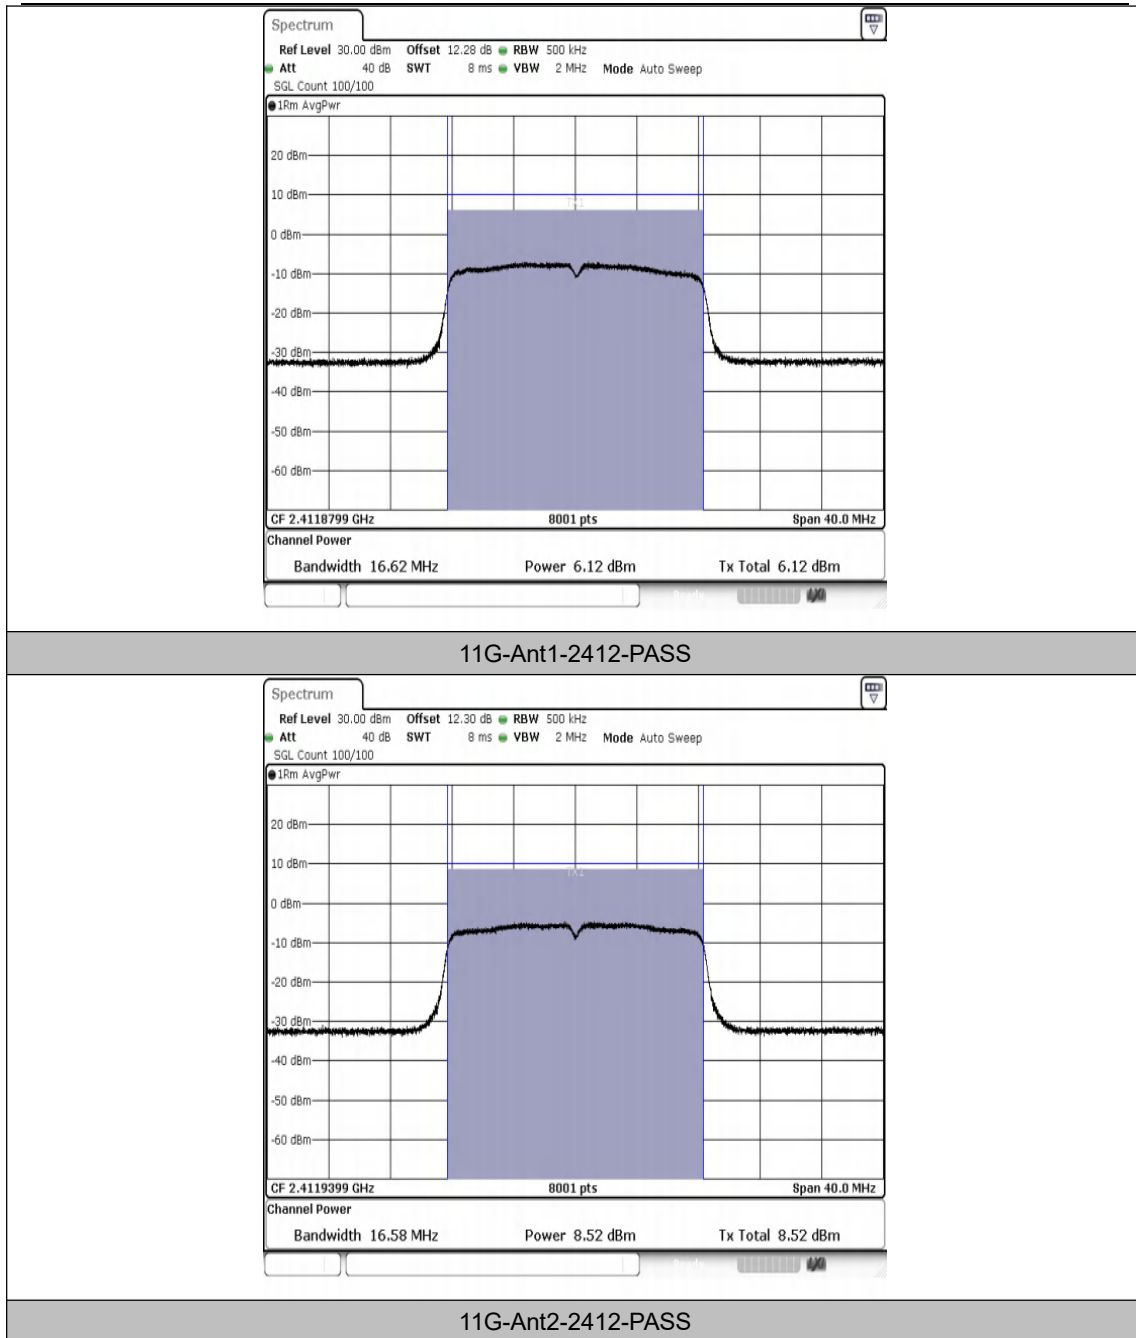

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

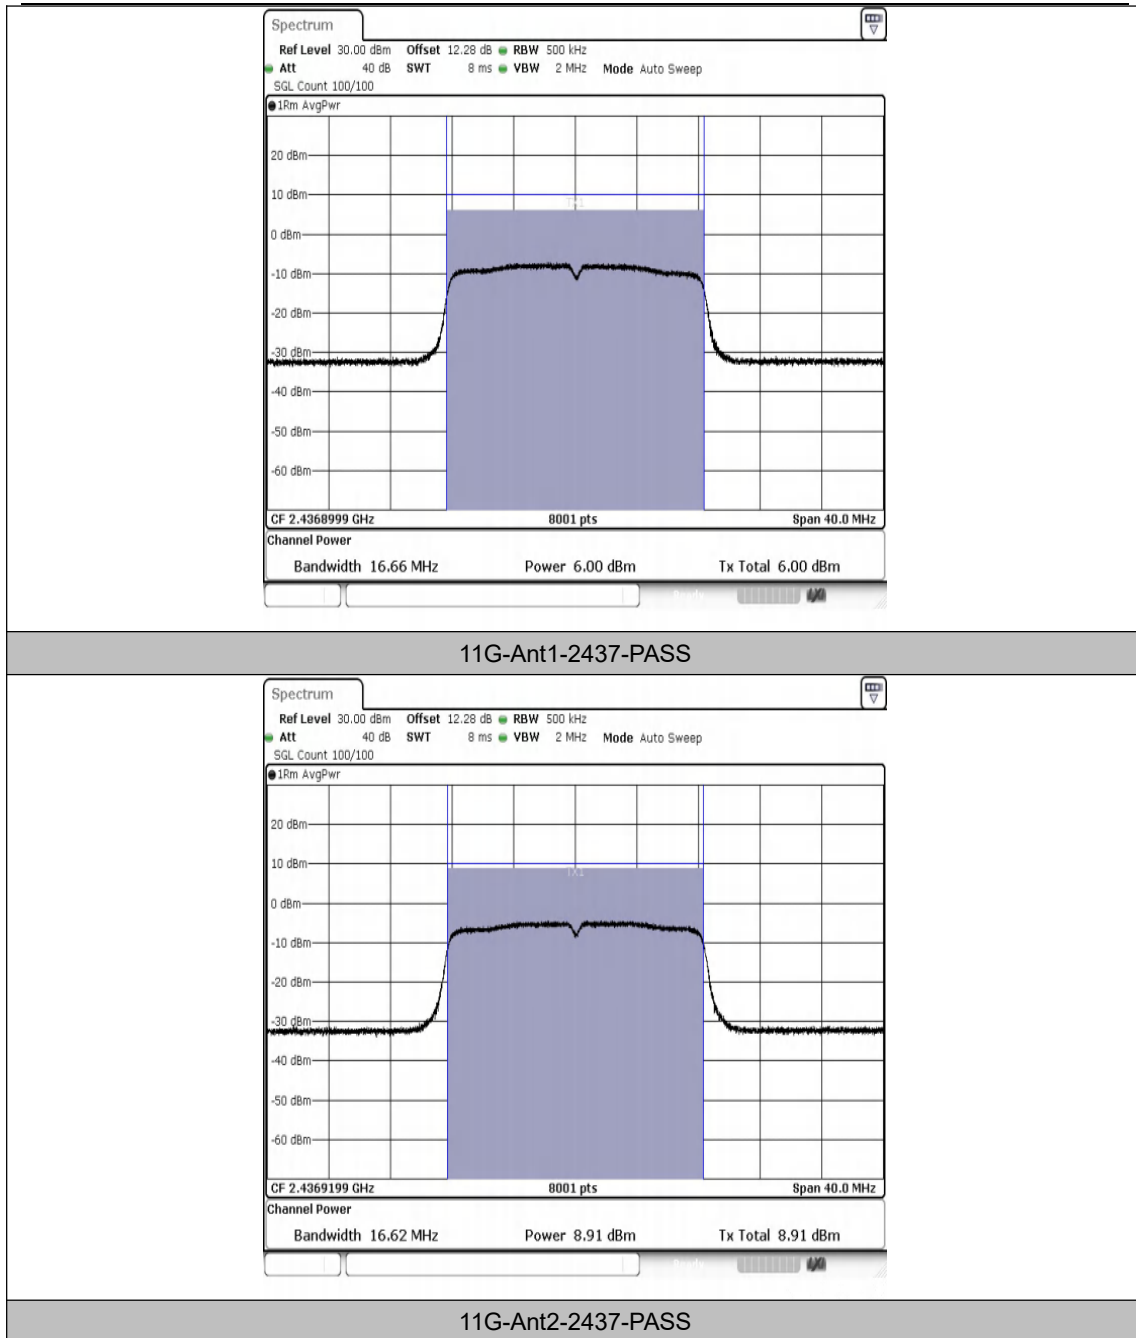

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

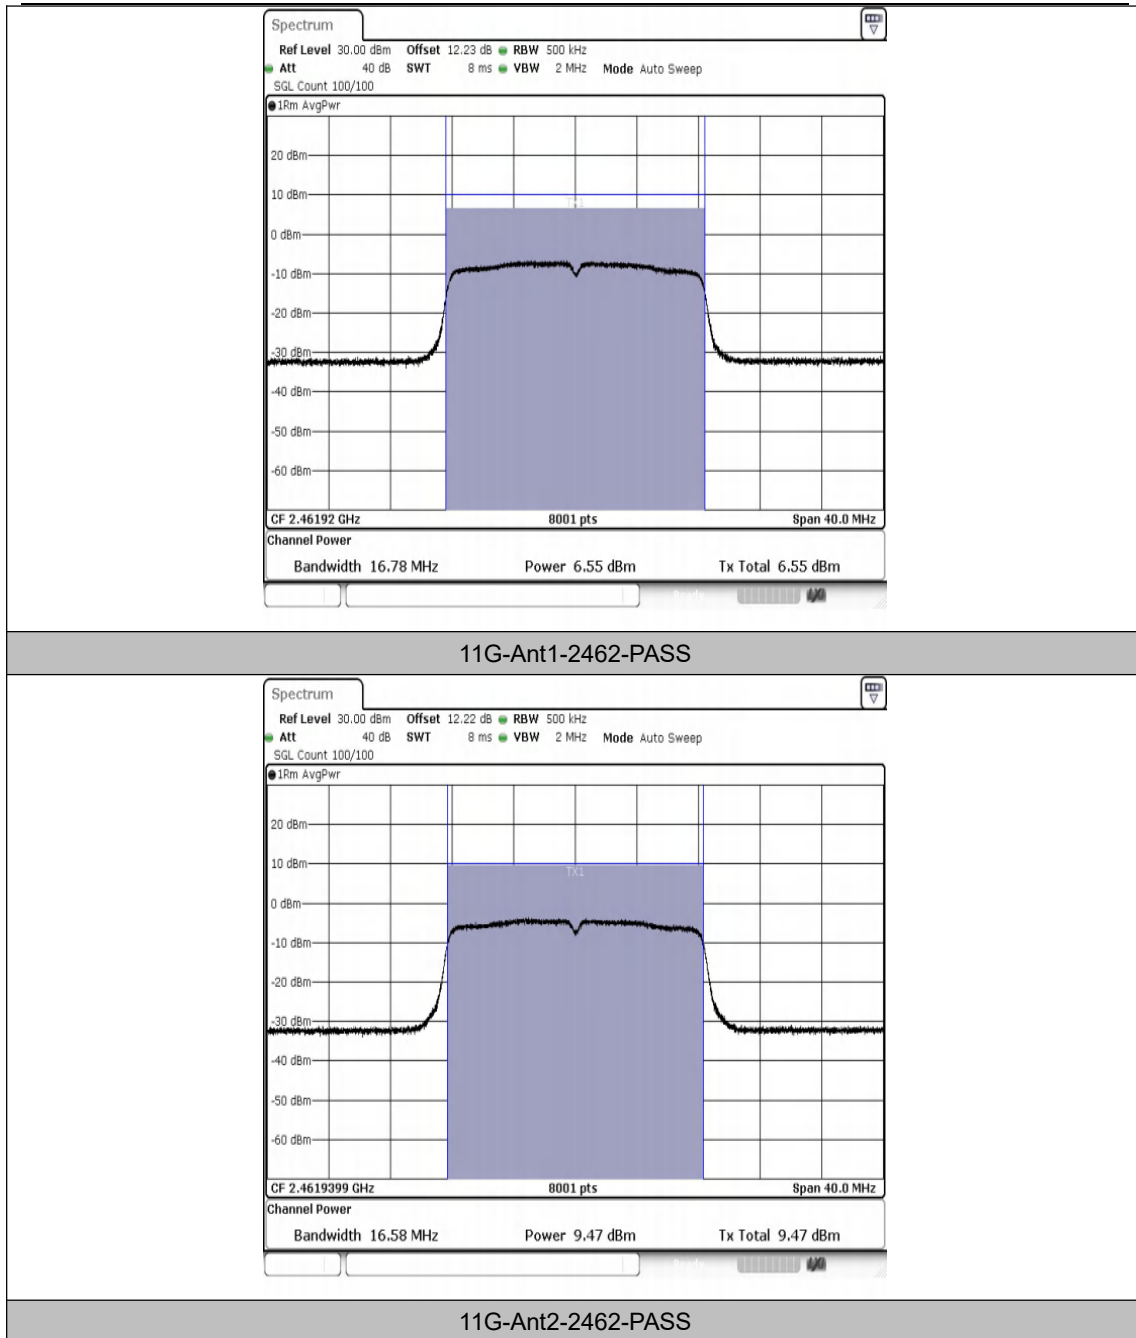

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

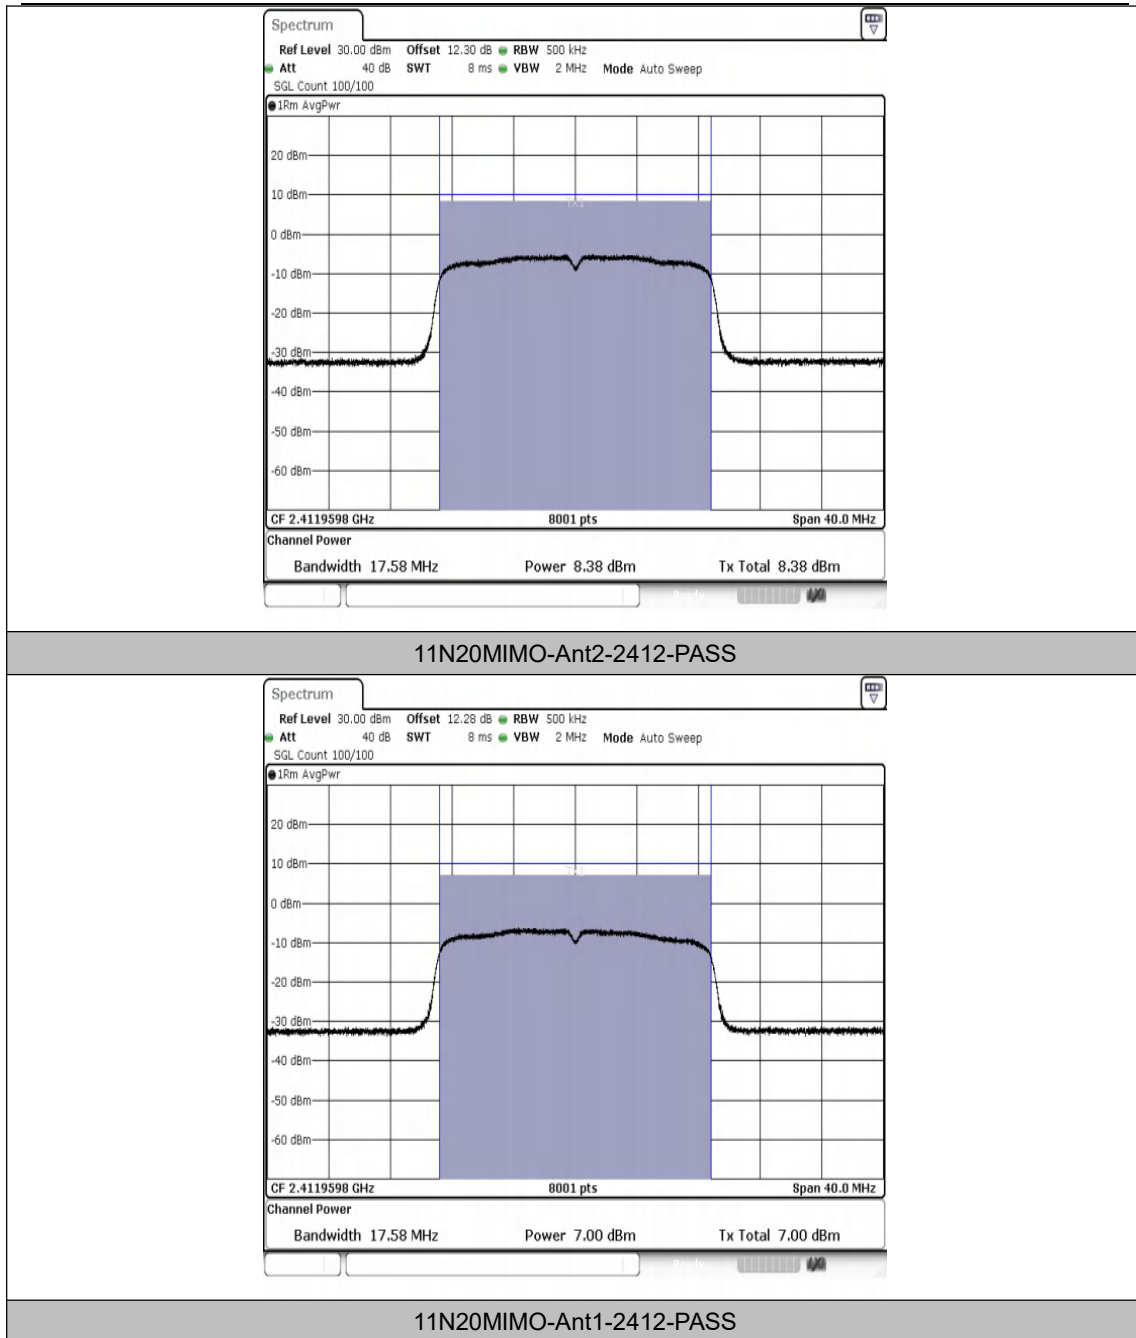

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

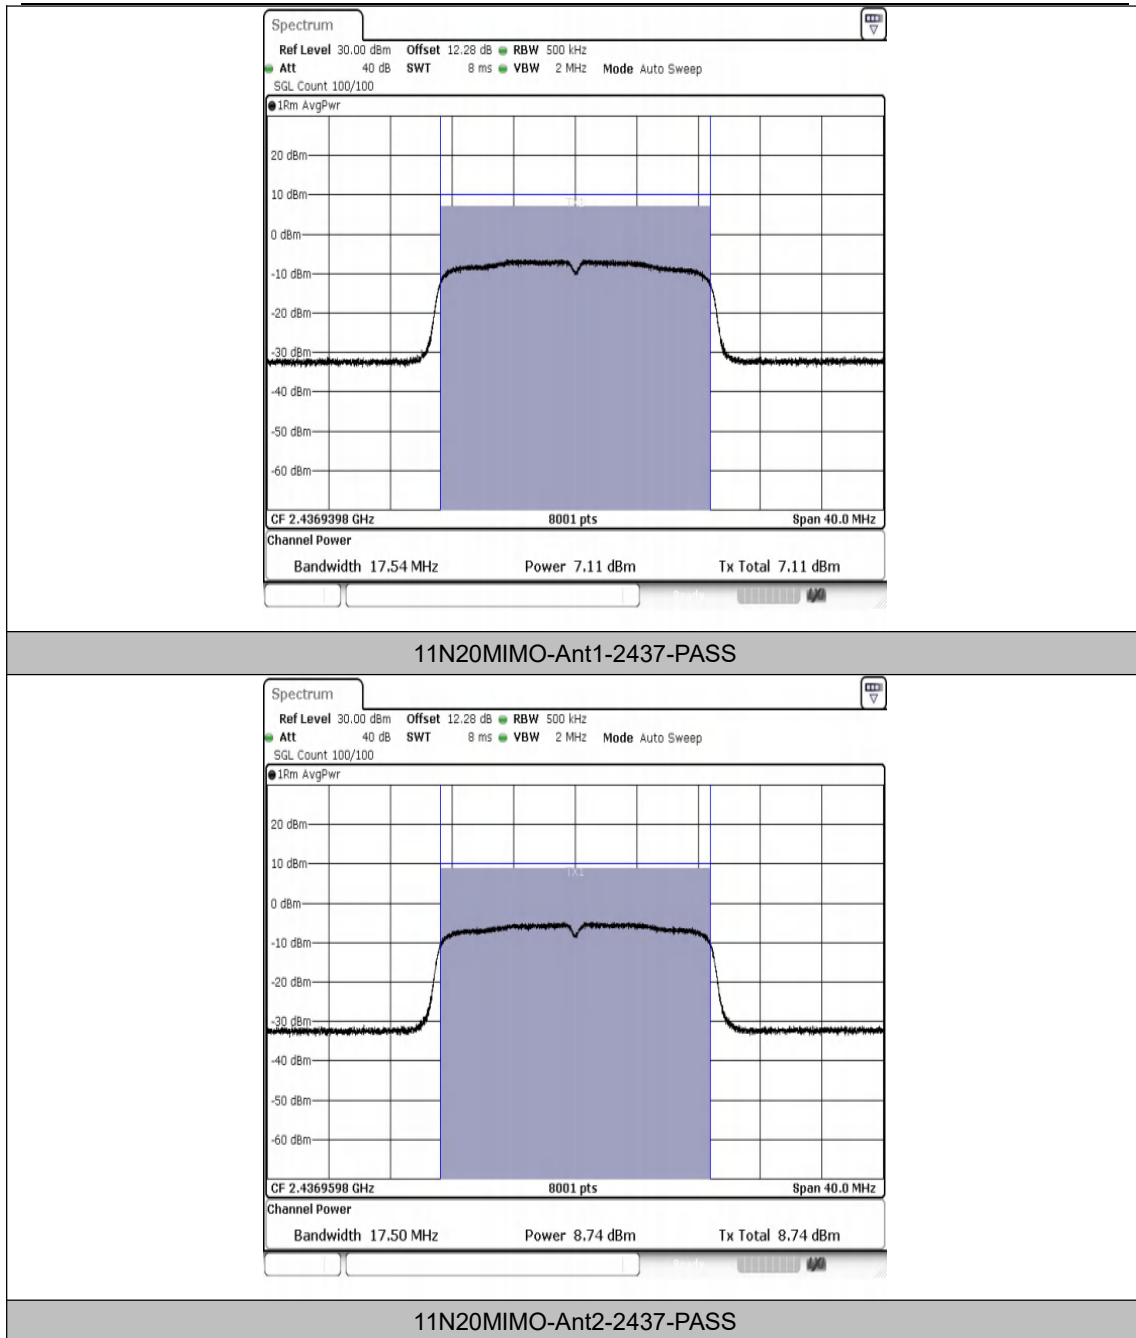

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

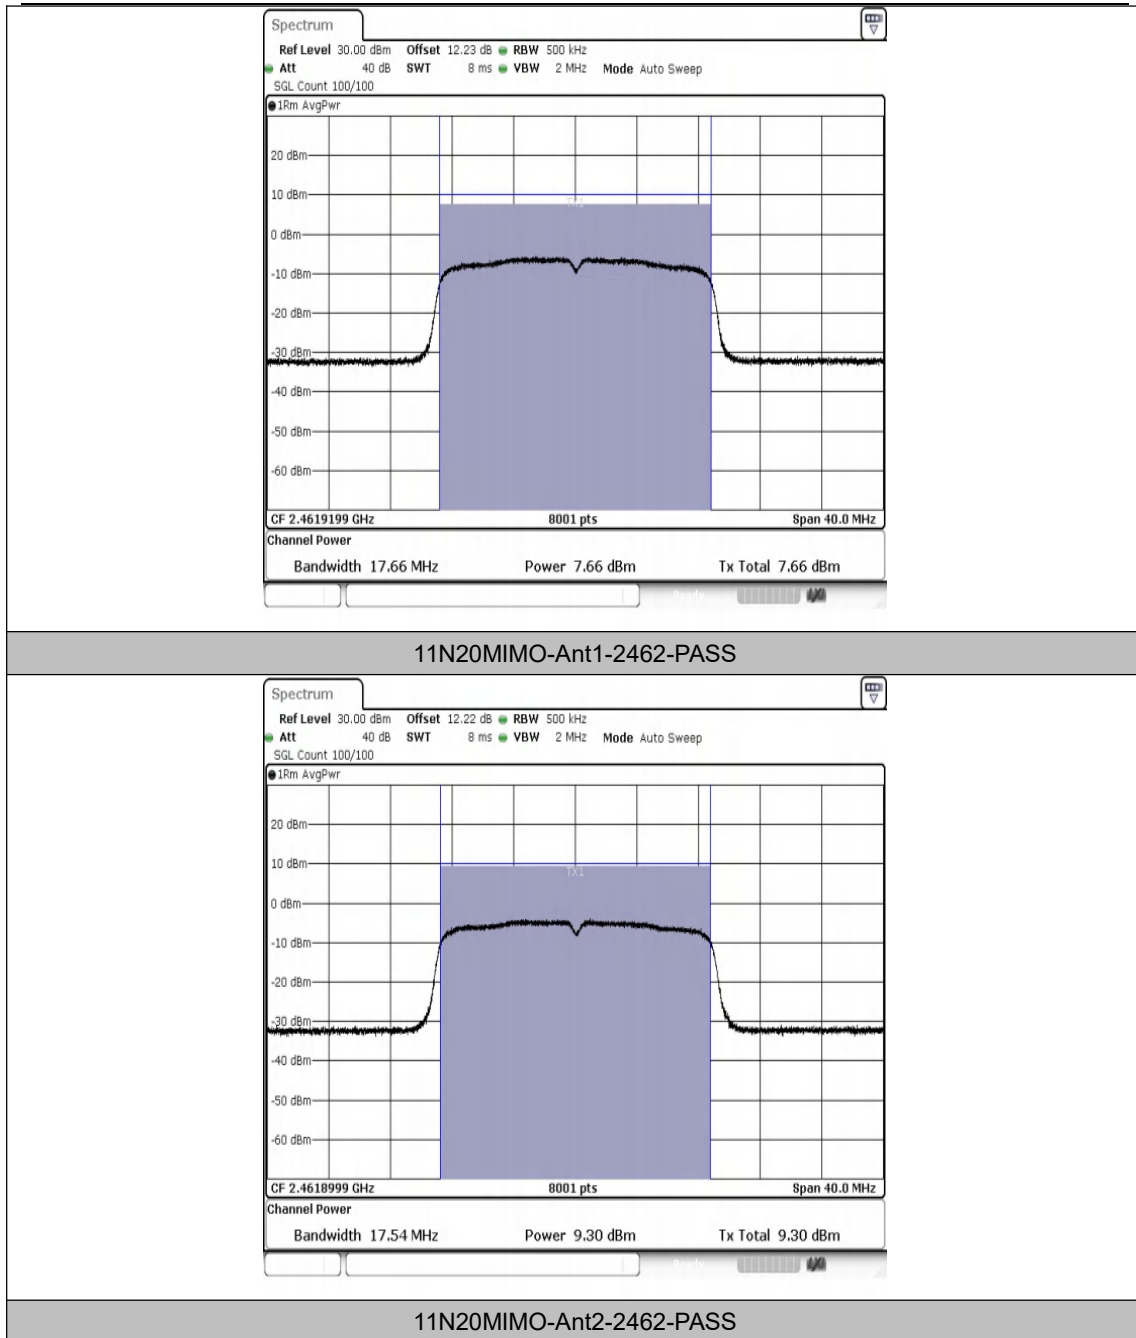

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

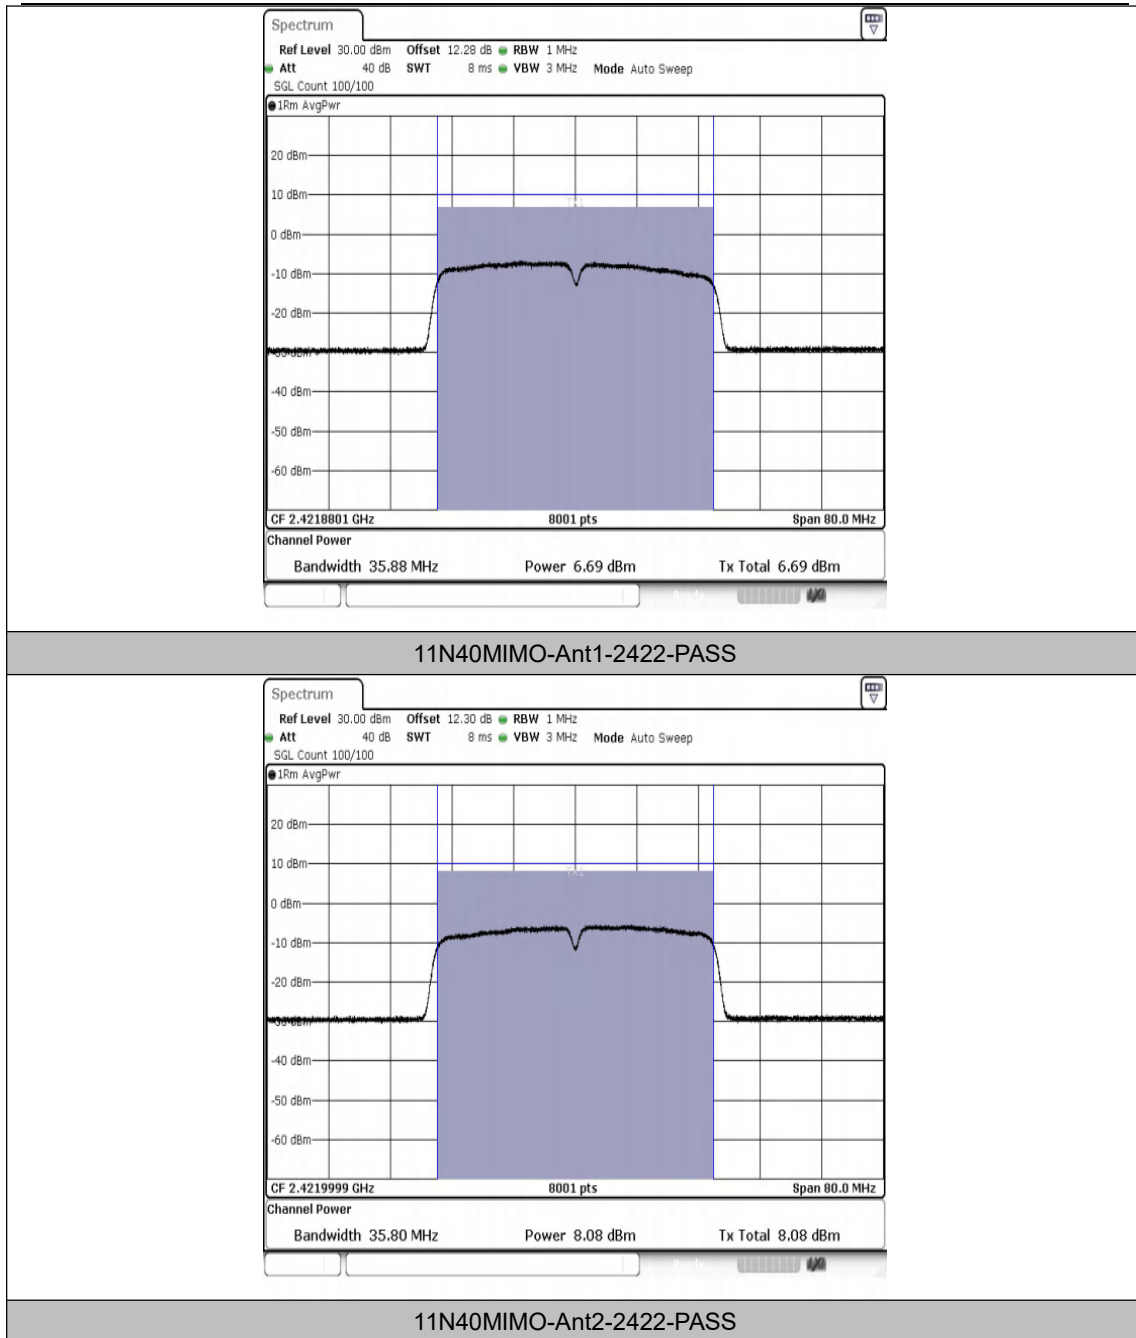

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

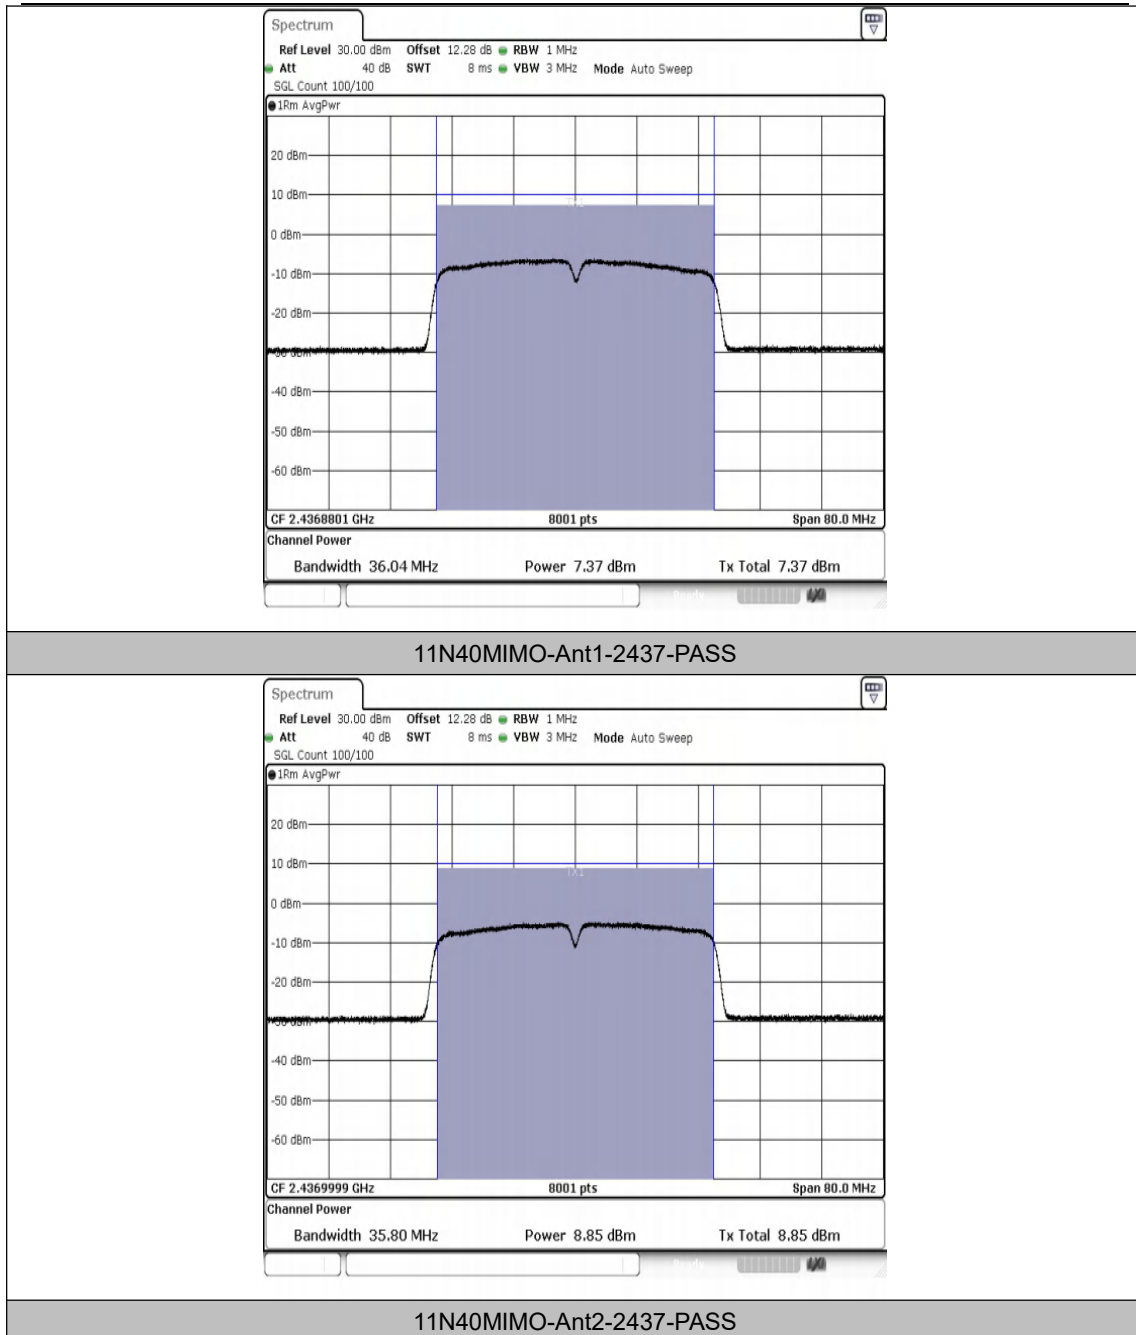

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

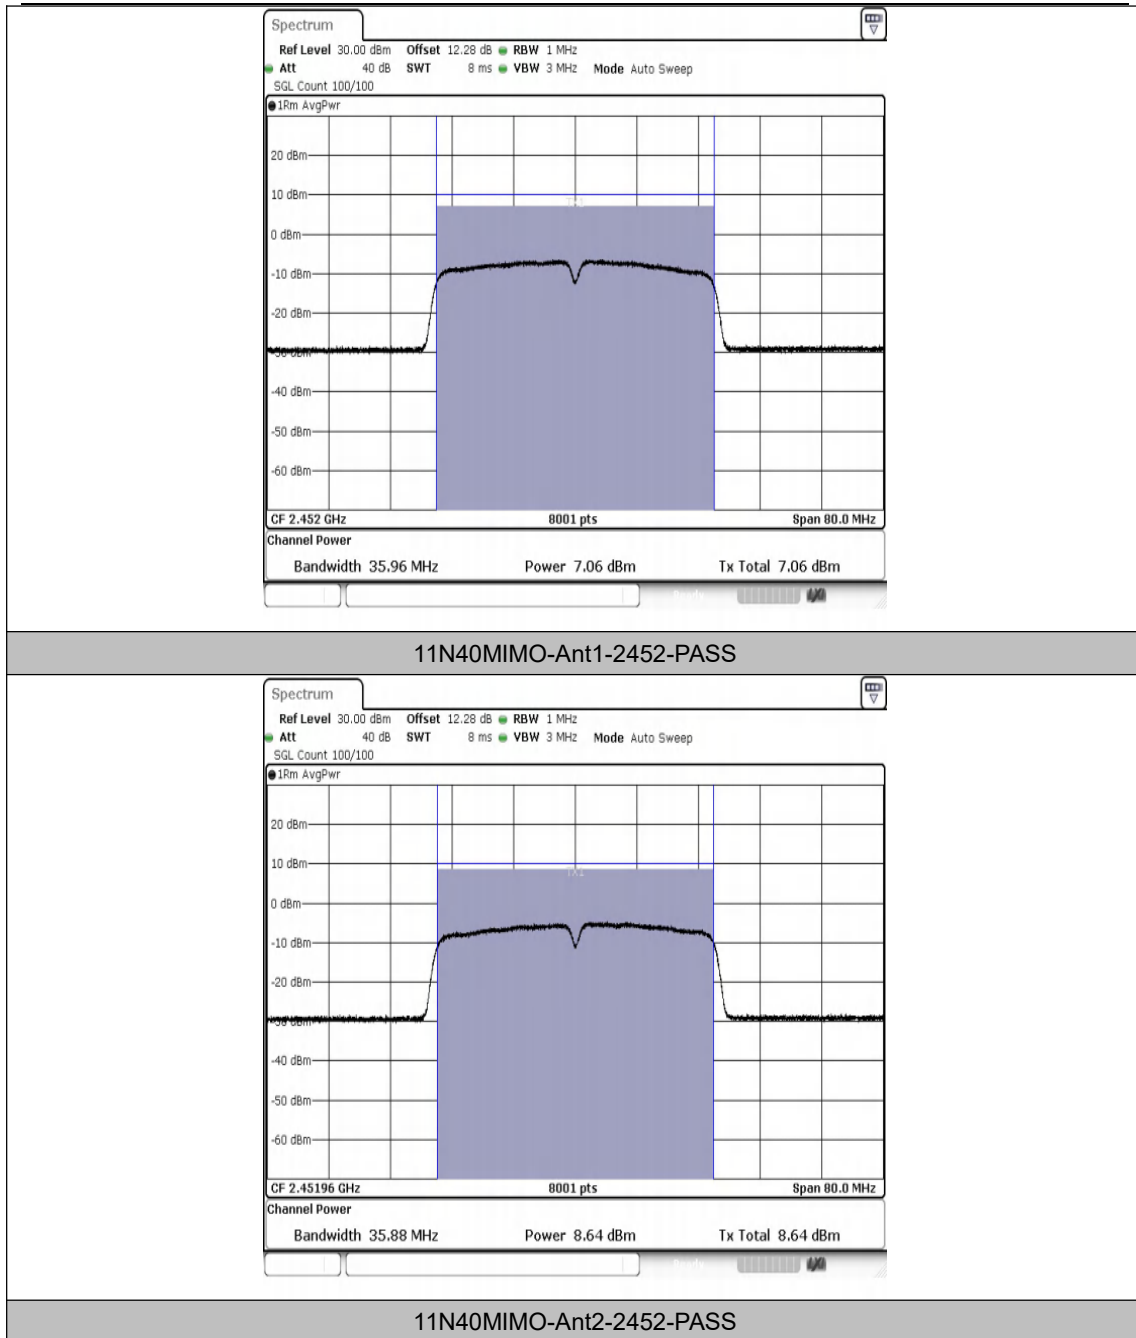

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

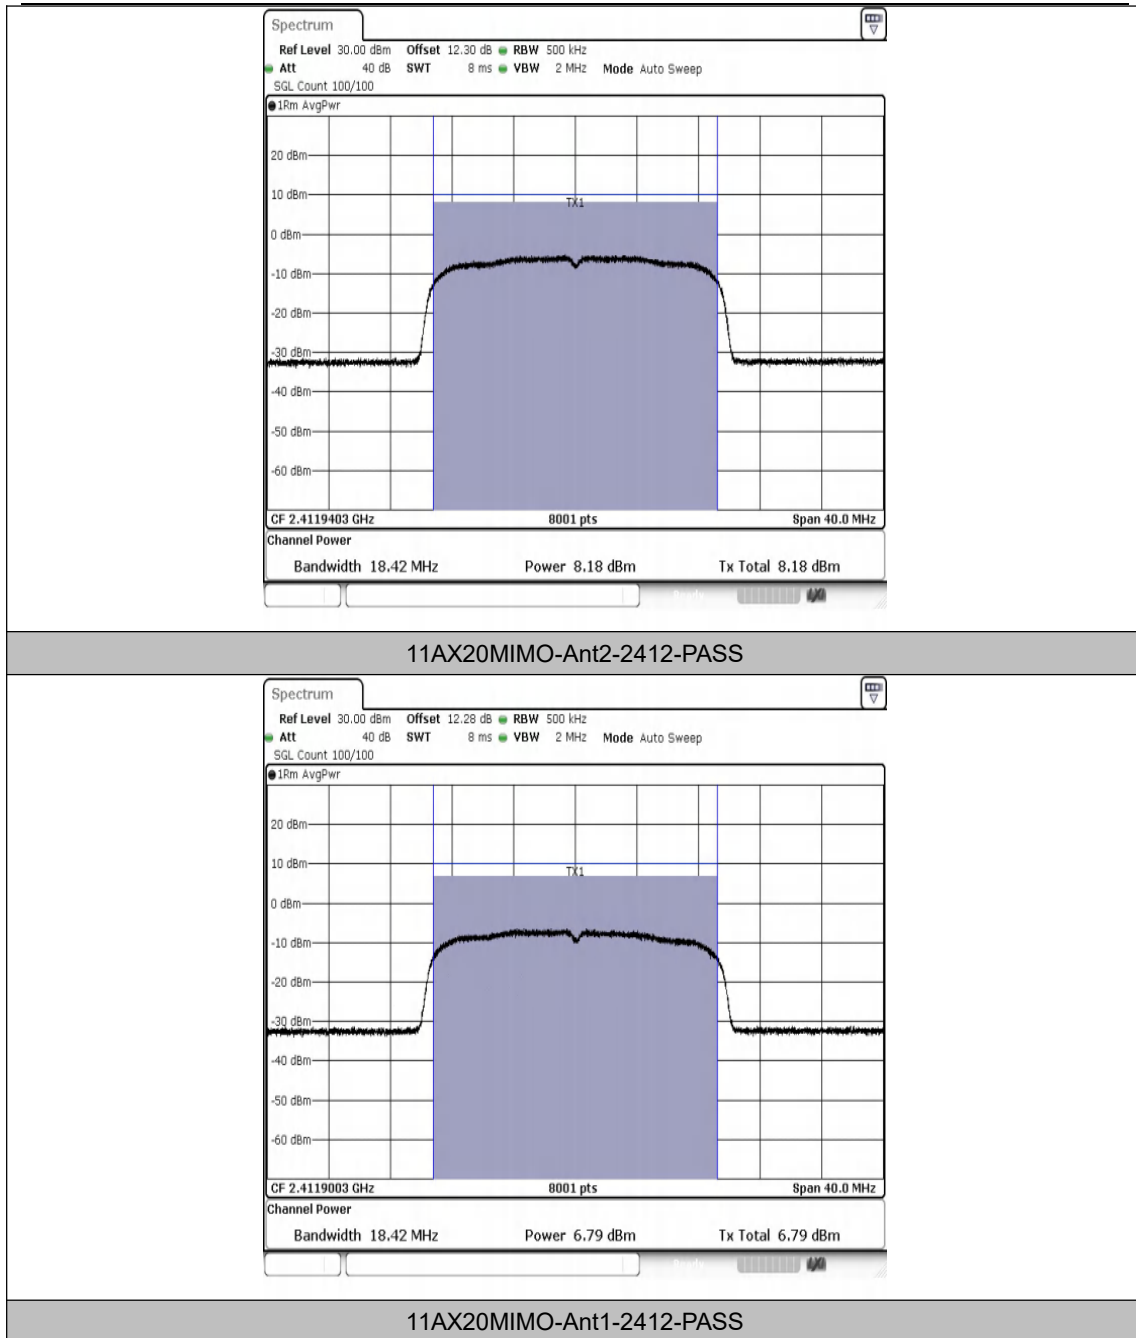


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

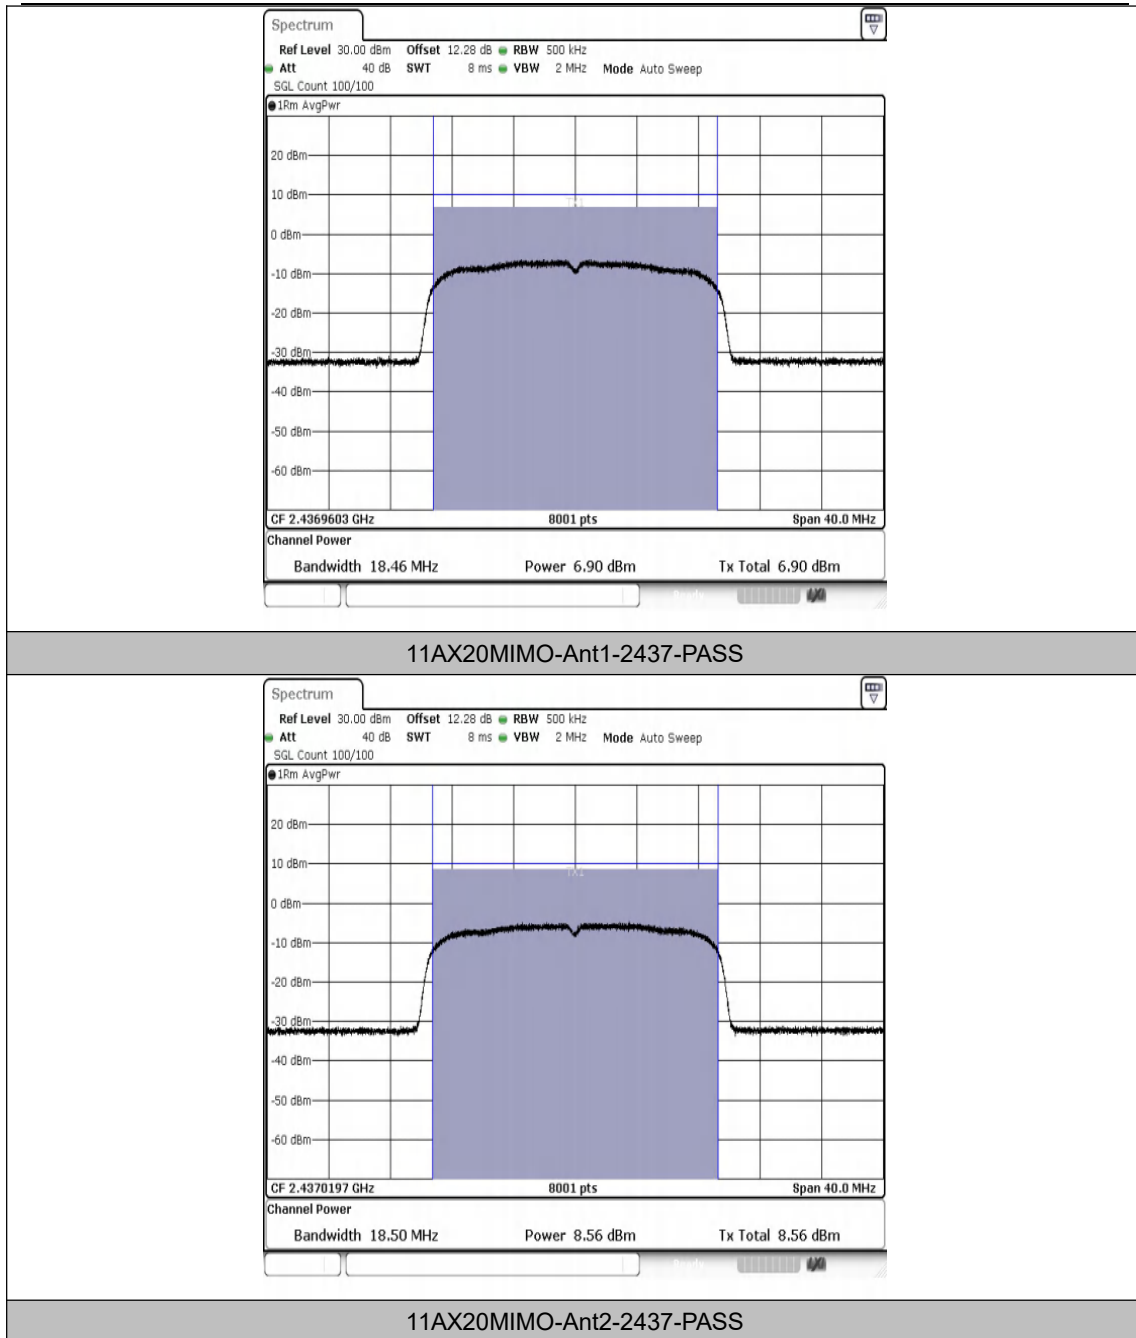


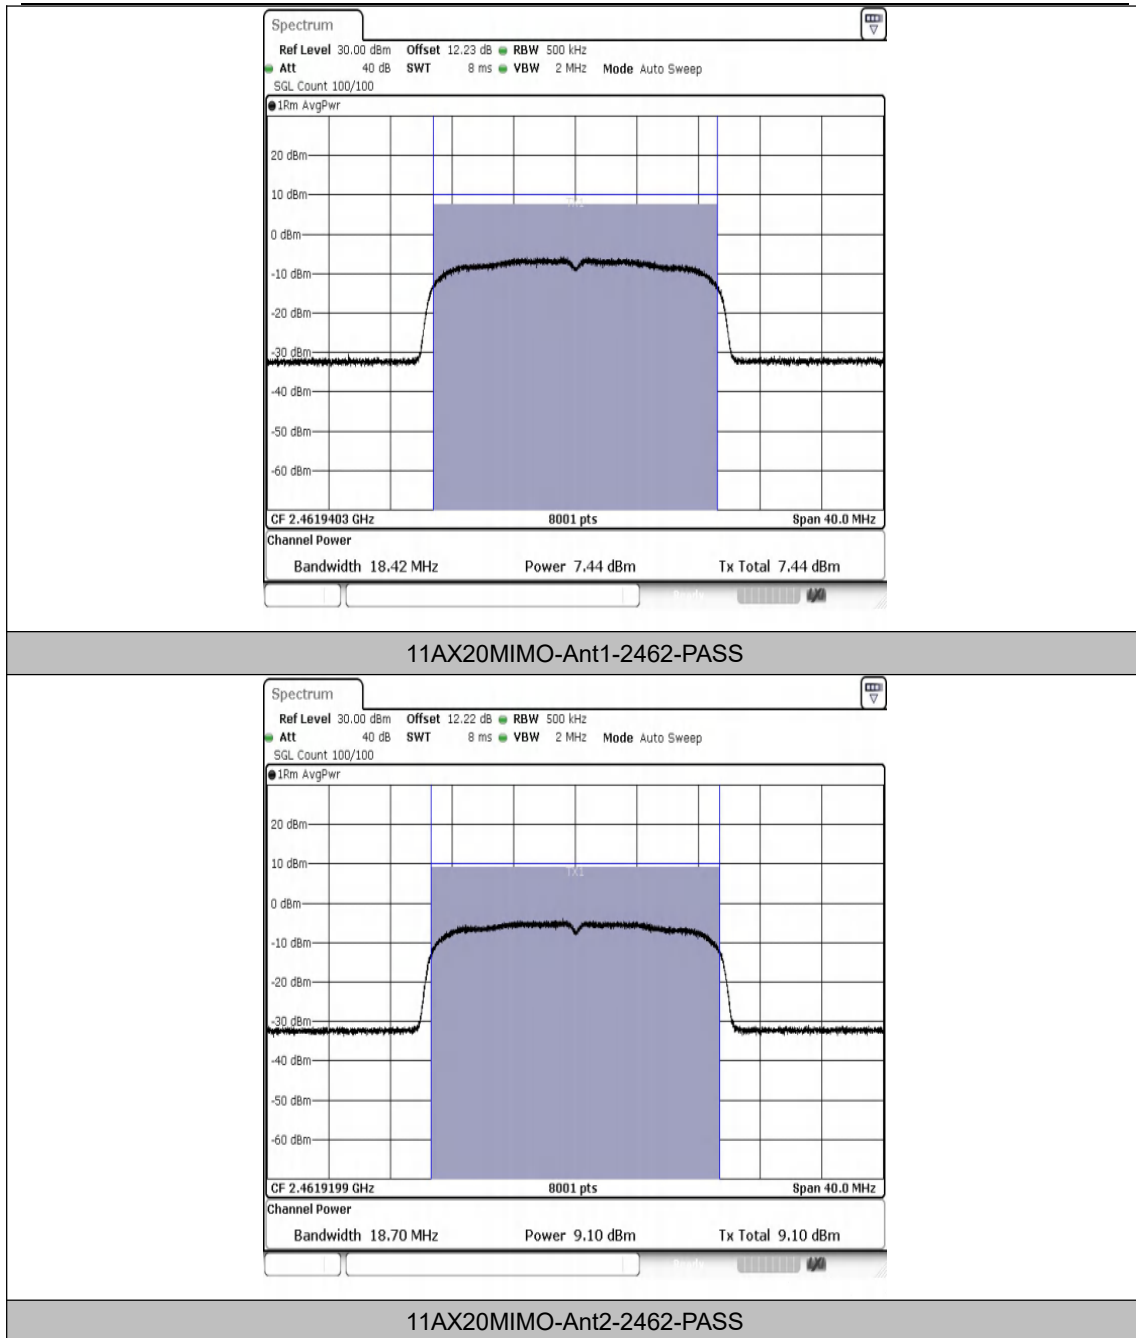

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

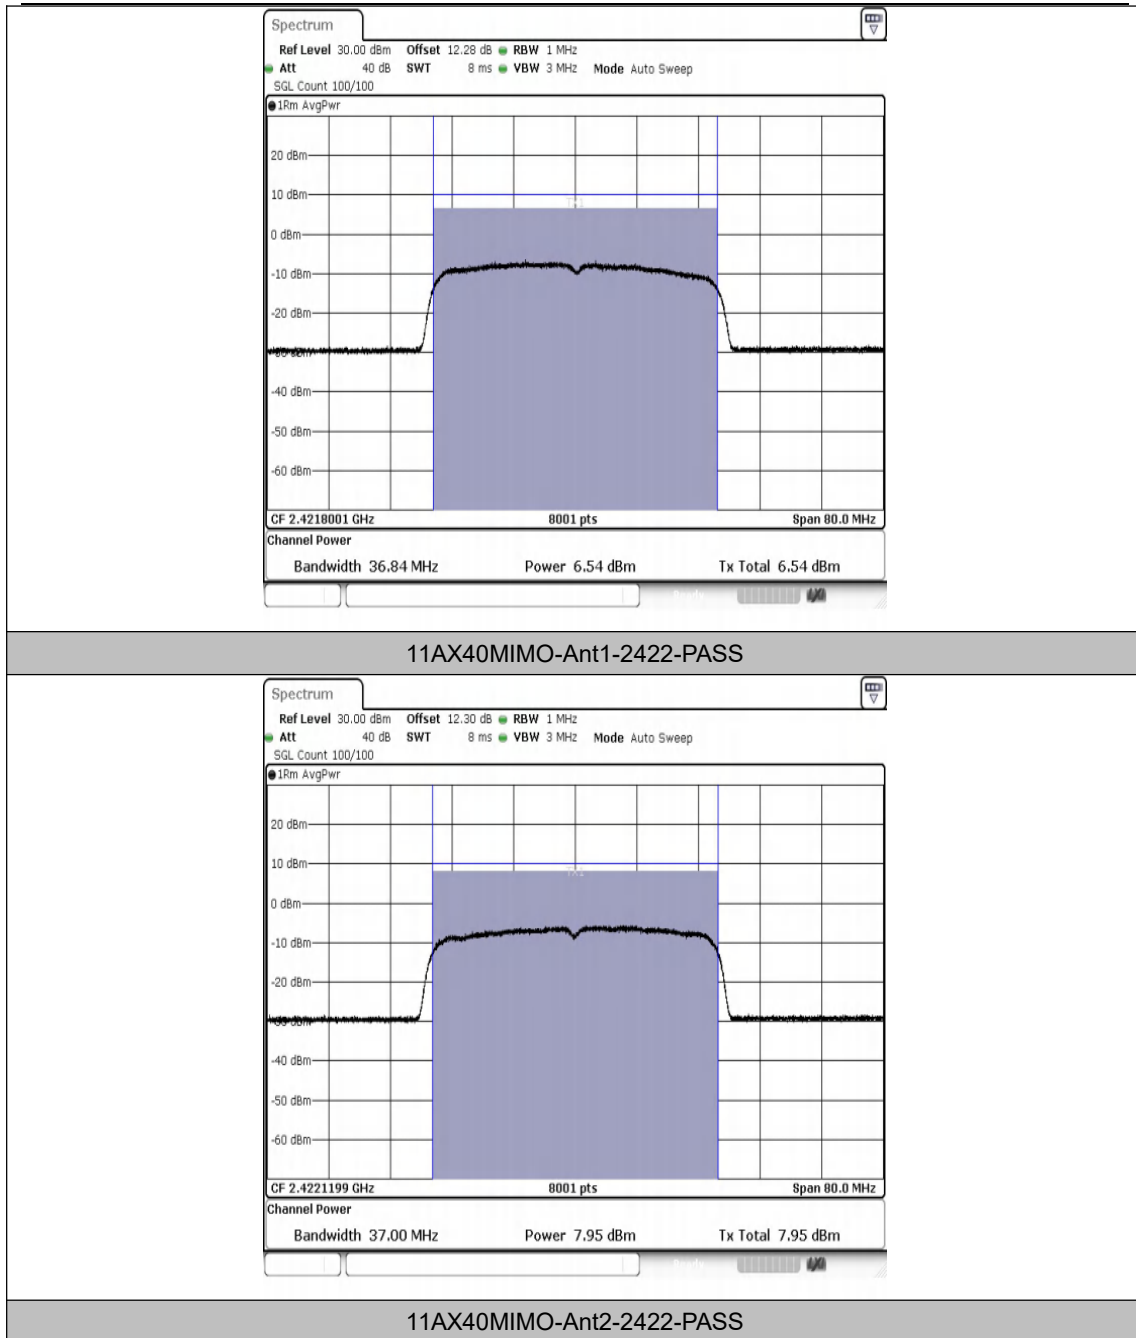

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

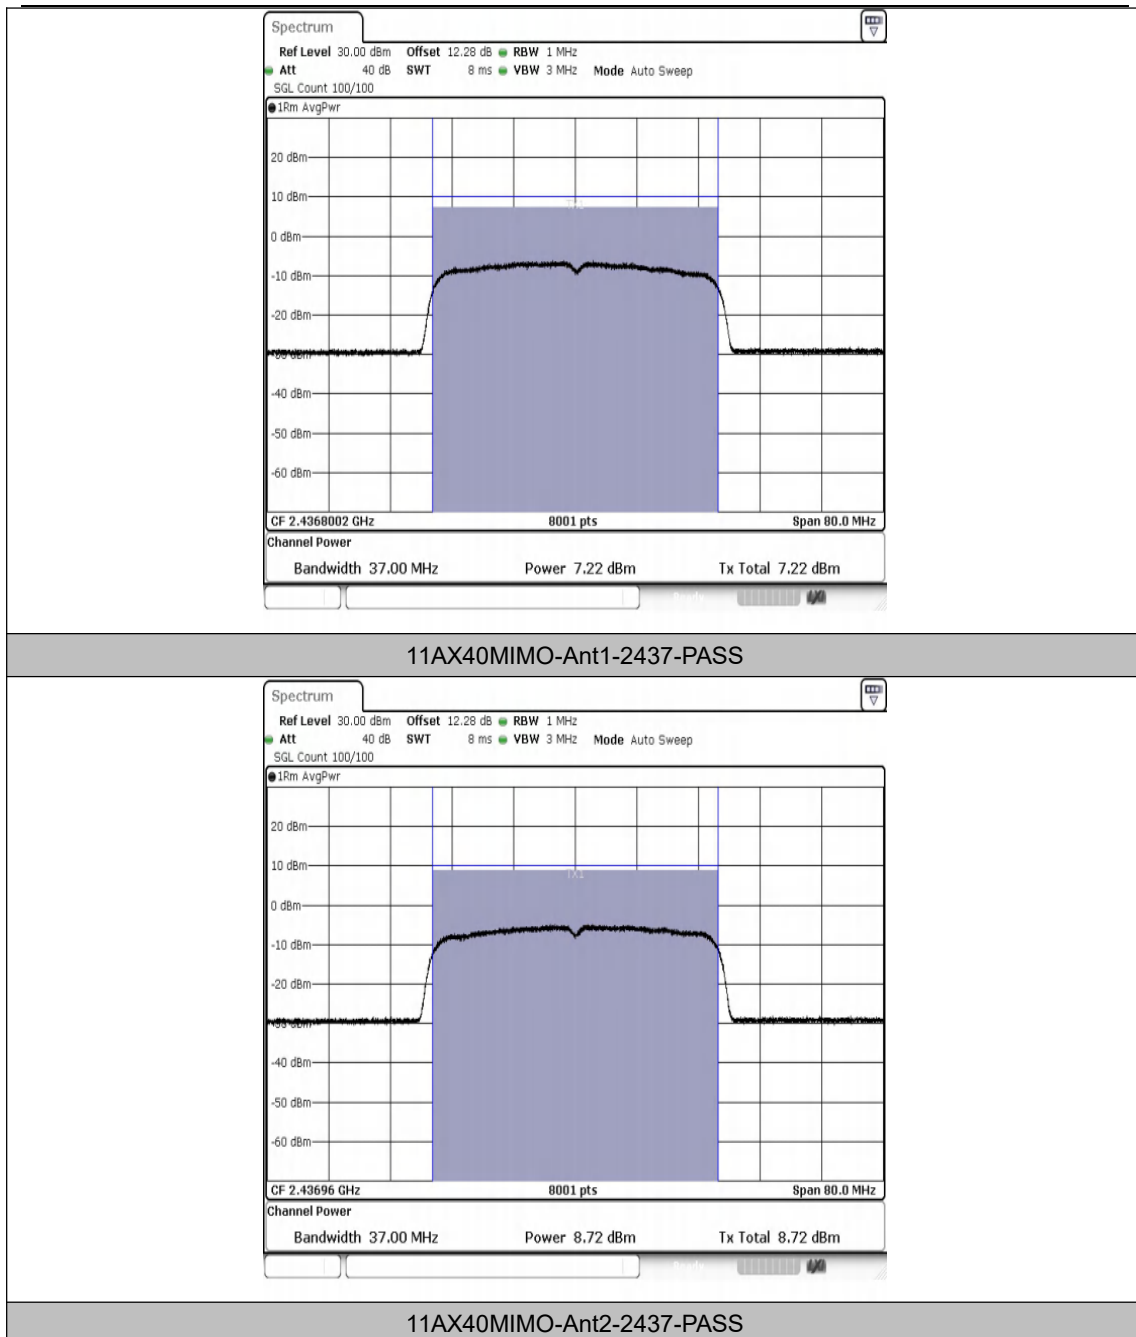

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

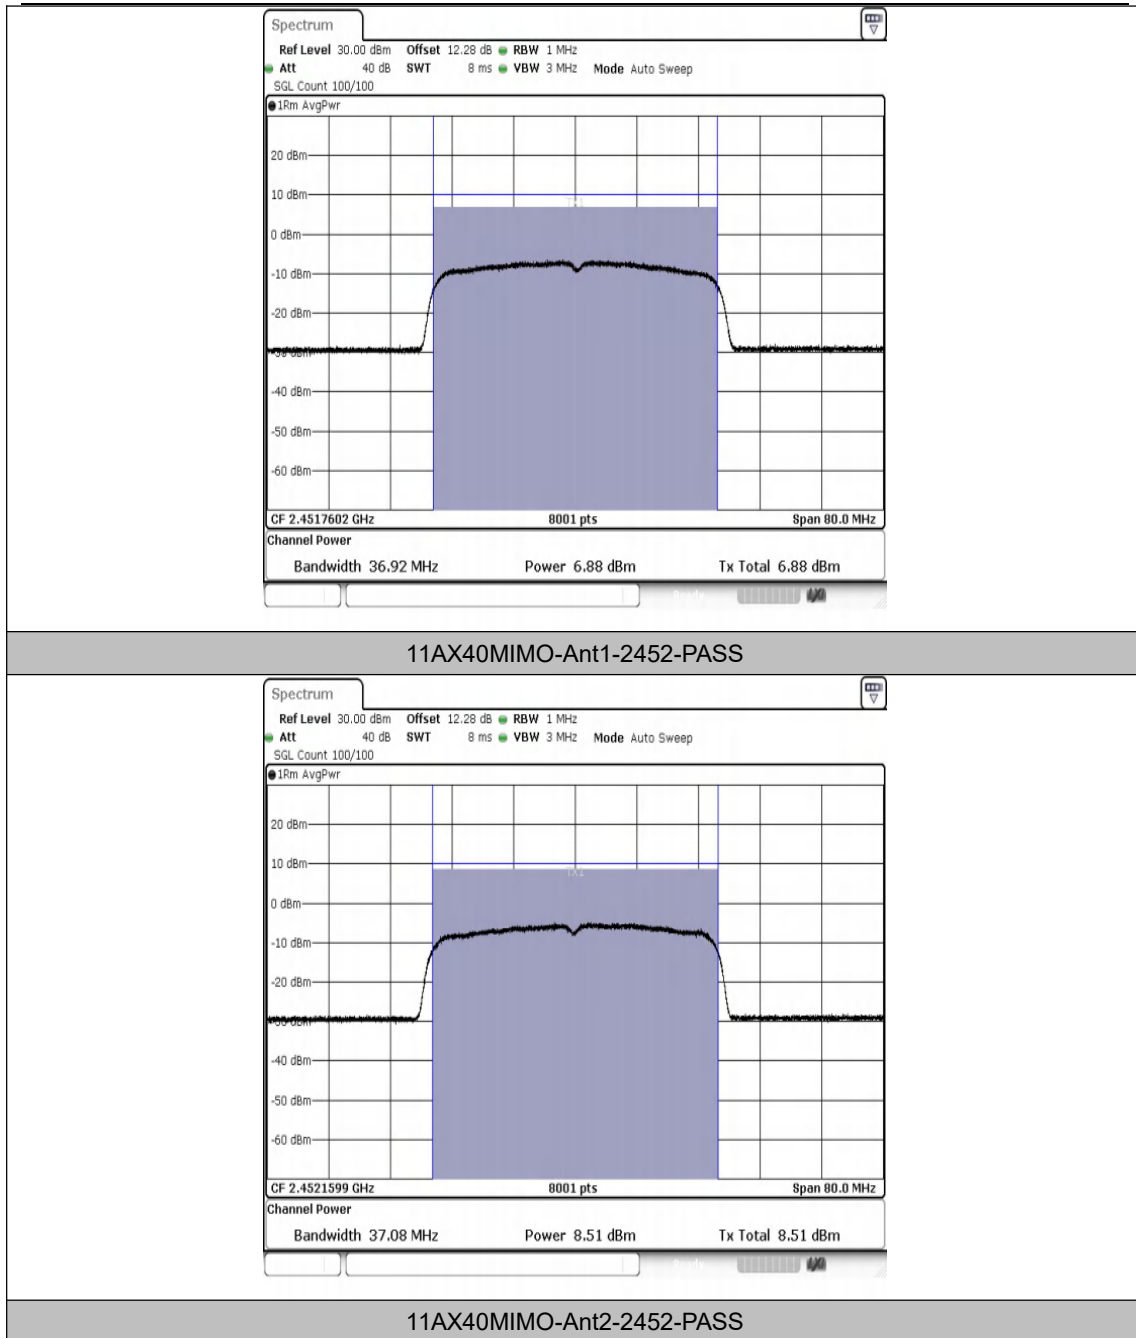

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix D: Maximum power spectral density

Test Result

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm/3kHz]	DC Factor [dB]	Result[dBm/3kHz]	Limit[dBm/3kHz]	Verdict
11B	Ant1	2412	-15.53	0.00	-15.53	≤8.00	PASS
11B	Ant2	2412	-13.52	0.00	-13.52	≤8.00	PASS
11B	Ant1	2437	-15.58	0.00	-15.58	≤8.00	PASS
11B	Ant2	2437	-13.41	0.00	-13.41	≤8.00	PASS
11B	Ant1	2462	-15.41	0.00	-15.41	≤8.00	PASS
11B	Ant2	2462	-12.49	0.00	-12.49	≤8.00	PASS
11G	Ant1	2412	-26.57	0.00	-26.57	≤8.00	PASS
11G	Ant2	2412	-25.31	0.00	-25.31	≤8.00	PASS
11G	Ant1	2437	-27.36	0.00	-27.36	≤8.00	PASS
11G	Ant2	2437	-24.71	0.00	-24.71	≤8.00	PASS
11G	Ant1	2462	-25.97	0.00	-25.97	≤8.00	PASS
11G	Ant2	2462	-23.99	0.00	-23.99	≤8.00	PASS
11N20MIMO	Ant1	2412	-26.89	0.00	-26.89	≤8.00	PASS
11N20MIMO	Ant2	2412	-25.46	0.00	-25.46	≤8.00	PASS
11N20MIMO	total	2412	---	---	-23.11	≤8.00	PASS
11N20MIMO	Ant1	2437	-25.31	0.00	-25.31	≤8.00	PASS
11N20MIMO	Ant2	2437	-25.21	0.00	-25.21	≤8.00	PASS
11N20MIMO	total	2437	---	---	-22.25	≤8.00	PASS
11N20MIMO	Ant1	2462	-24.44	0.00	-24.44	≤8.00	PASS
11N20MIMO	Ant2	2462	-23.81	0.00	-23.81	≤8.00	PASS
11N20MIMO	total	2462	---	---	-21.10	≤8.00	PASS
11N40MIMO	Ant2	2422	-28.79	0.00	-28.79	≤8.00	PASS
11N40MIMO	total	2422	---	---	-25.37	≤8.00	PASS
11N40MIMO	Ant1	2422	-28.01	0.00	-28.01	≤8.00	PASS
11N40MIMO	Ant1	2437	-25.69	0.00	-25.69	≤8.00	PASS
11N40MIMO	Ant2	2437	-28.03	0.00	-28.03	≤8.00	PASS
11N40MIMO	total	2437	---	---	-23.69	≤8.00	PASS
11N40MIMO	Ant1	2452	-25.56	0.00	-25.56	≤8.00	PASS
11N40MIMO	Ant2	2452	-28.16	0.00	-28.16	≤8.00	PASS
11N40MIMO	total	2452	---	---	-23.66	≤8.00	PASS
11AX20MIMO	Ant1	2412	-27.75	0.00	-27.75	≤8.00	PASS
11AX20MIMO	Ant2	2412	-26.18	0.00	-26.18	≤8.00	PASS
11AX20MIMO	total	2412	---	---	-23.88	≤8.00	PASS
11AX20MIMO	Ant1	2437	-25.64	0.00	-25.64	≤8.00	PASS
11AX20MIMO	Ant2	2437	-25.85	0.00	-25.85	≤8.00	PASS
11AX20MIMO	total	2437	---	---	-22.73	≤8.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

11AX20MIMO	Ant1	2462	-23.88	0.00	-23.88	≤8.00	PASS
11AX20MIMO	Ant2	2462	-25.13	0.00	-25.13	≤8.00	PASS
11AX20MIMO	total	2462	---	---	-21.45	≤8.00	PASS
11AX40MIMO	Ant1	2422	-28.04	0.00	-28.04	≤8.00	PASS
11AX40MIMO	Ant2	2422	-29.17	0.00	-29.17	≤8.00	PASS
11AX40MIMO	total	2422	---	---	-25.56	≤8.00	PASS
11AX40MIMO	Ant1	2437	-25.61	0.00	-25.61	≤8.00	PASS
11AX40MIMO	Ant2	2437	-28.87	0.00	-28.87	≤8.00	PASS
11AX40MIMO	total	2437	---	---	-23.93	≤8.00	PASS
11AX40MIMO	Ant1	2452	-25.47	0.00	-25.47	≤8.00	PASS
11AX40MIMO	Ant2	2452	-28.66	0.00	-28.66	≤8.00	PASS
11AX40MIMO	total	2452	---	---	-23.77	≤8.00	PASS

Note: 1. The cable loss are compensated in the graph.


Test Graphs

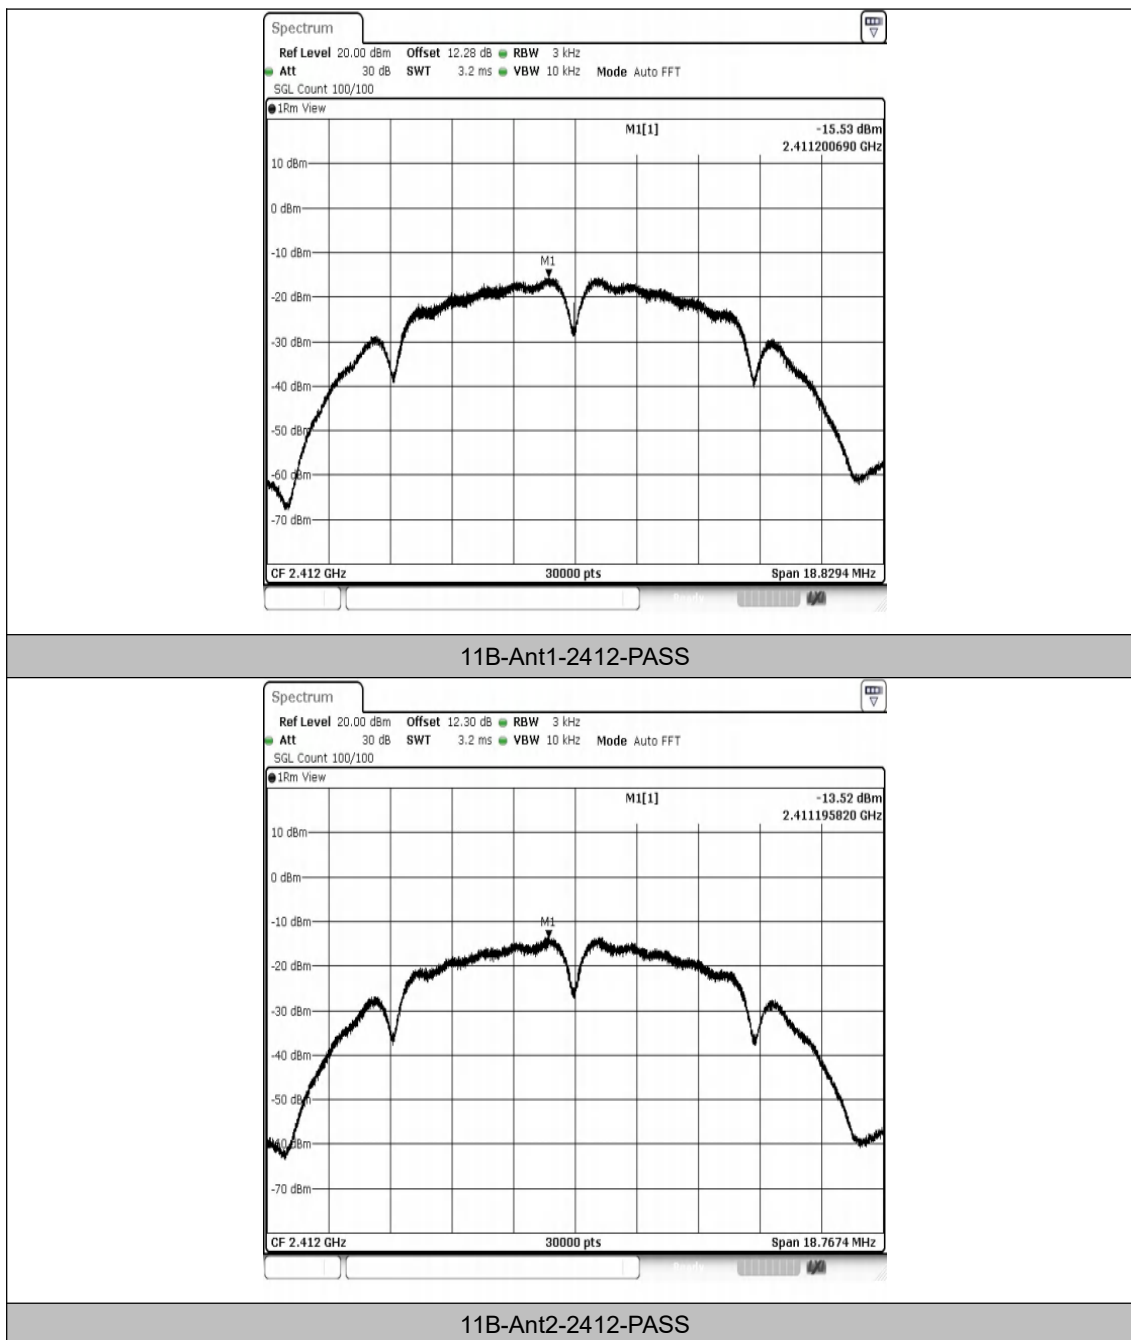

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

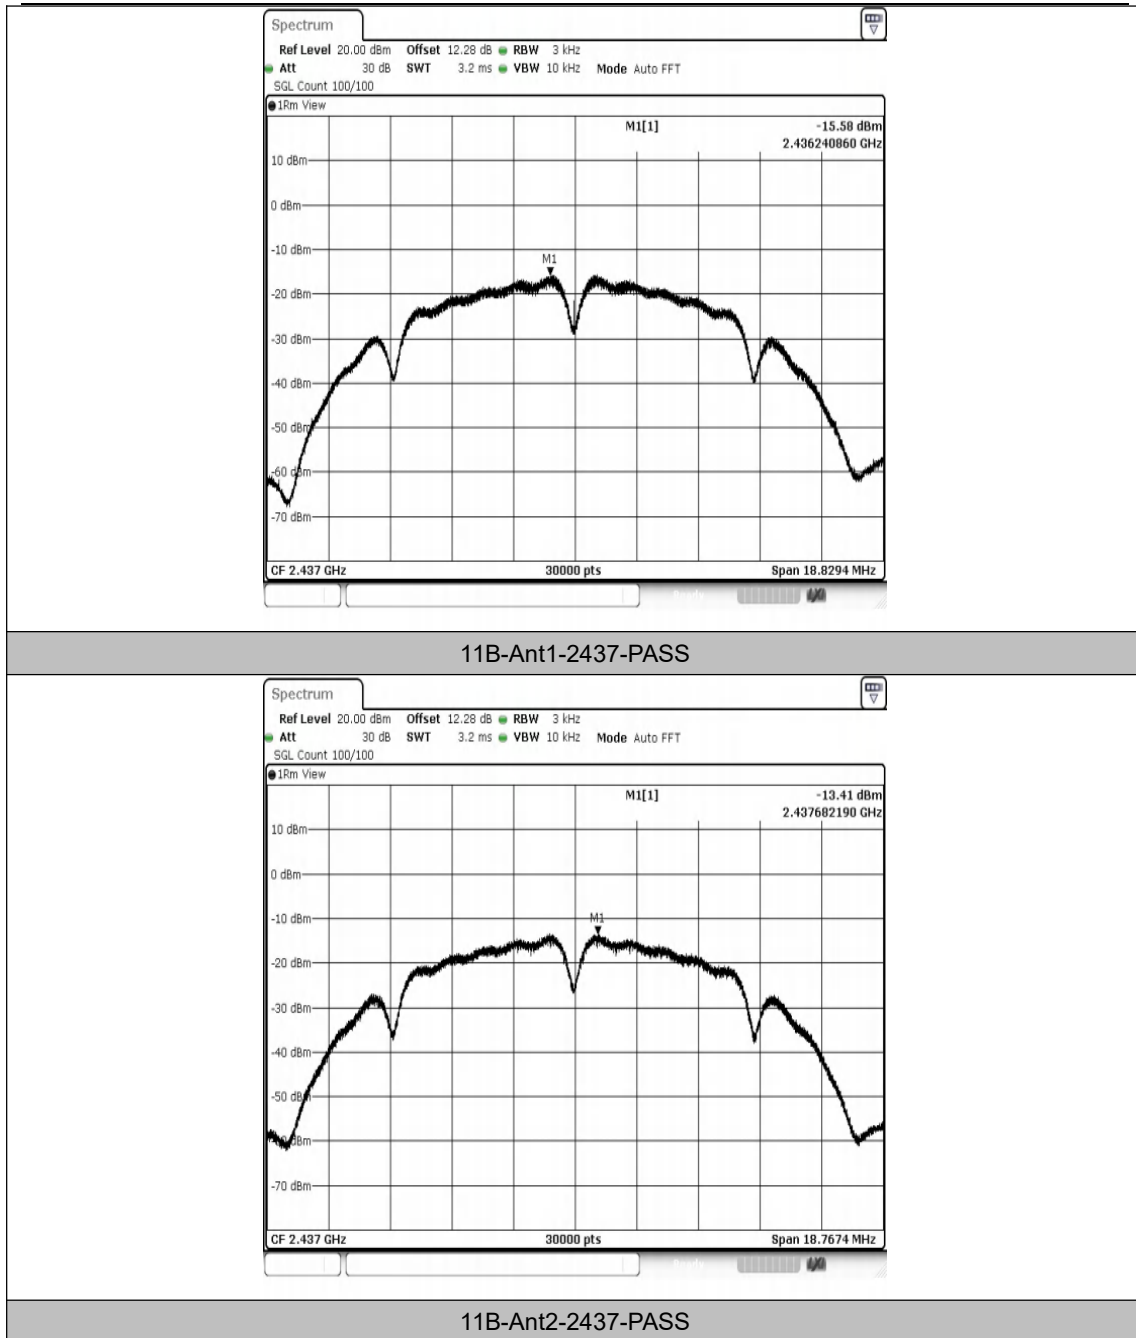



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

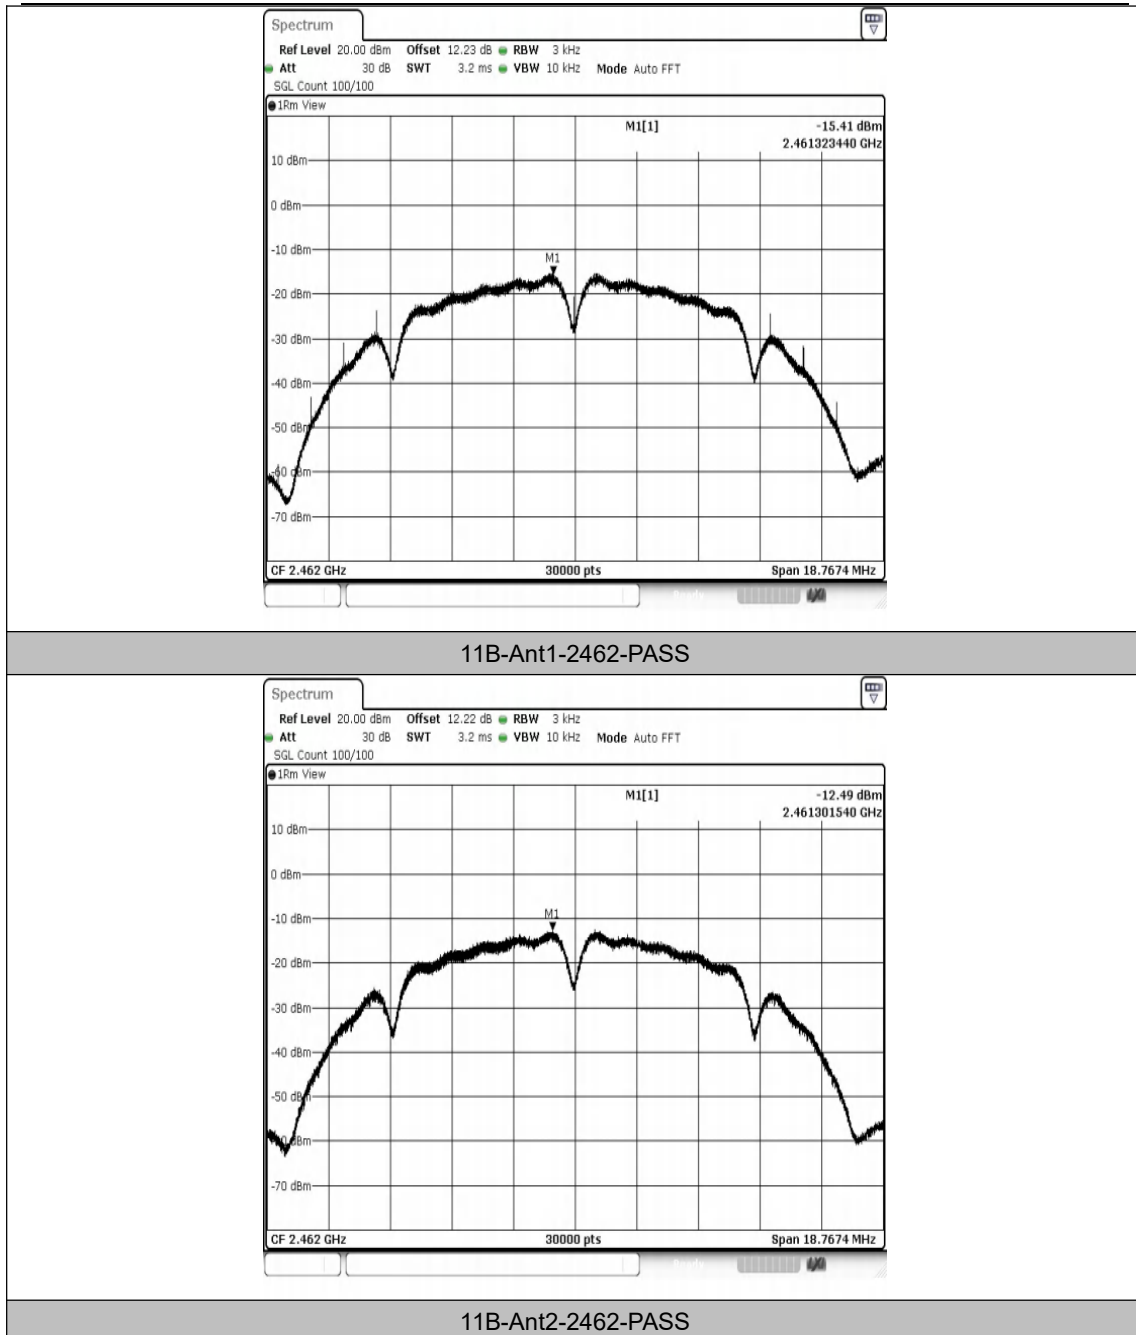

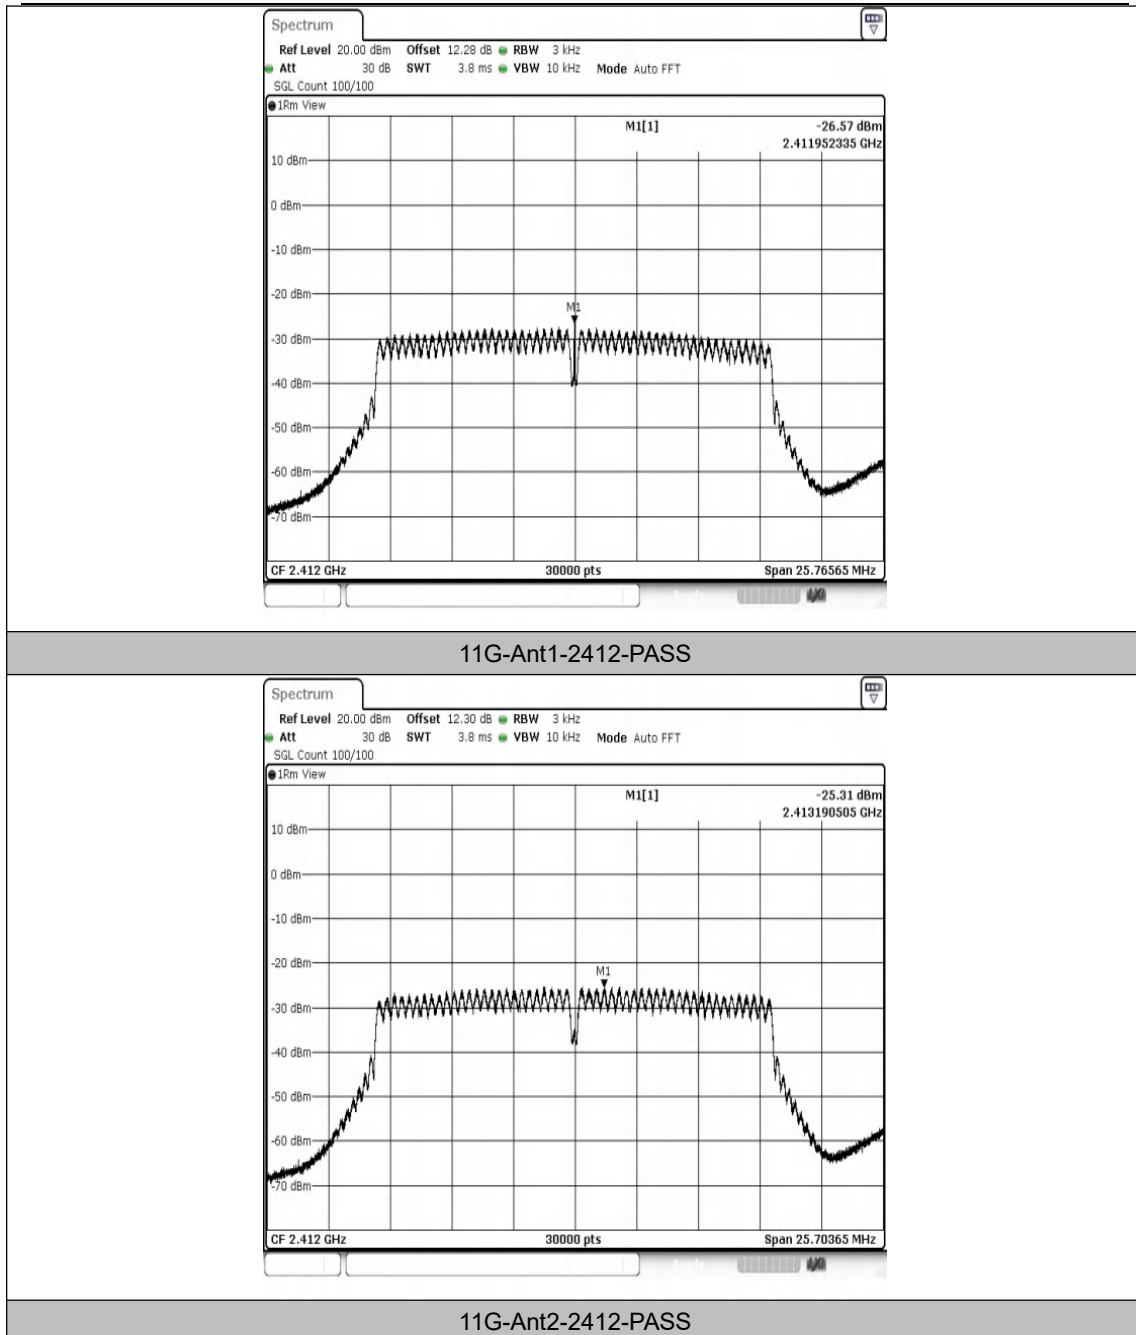


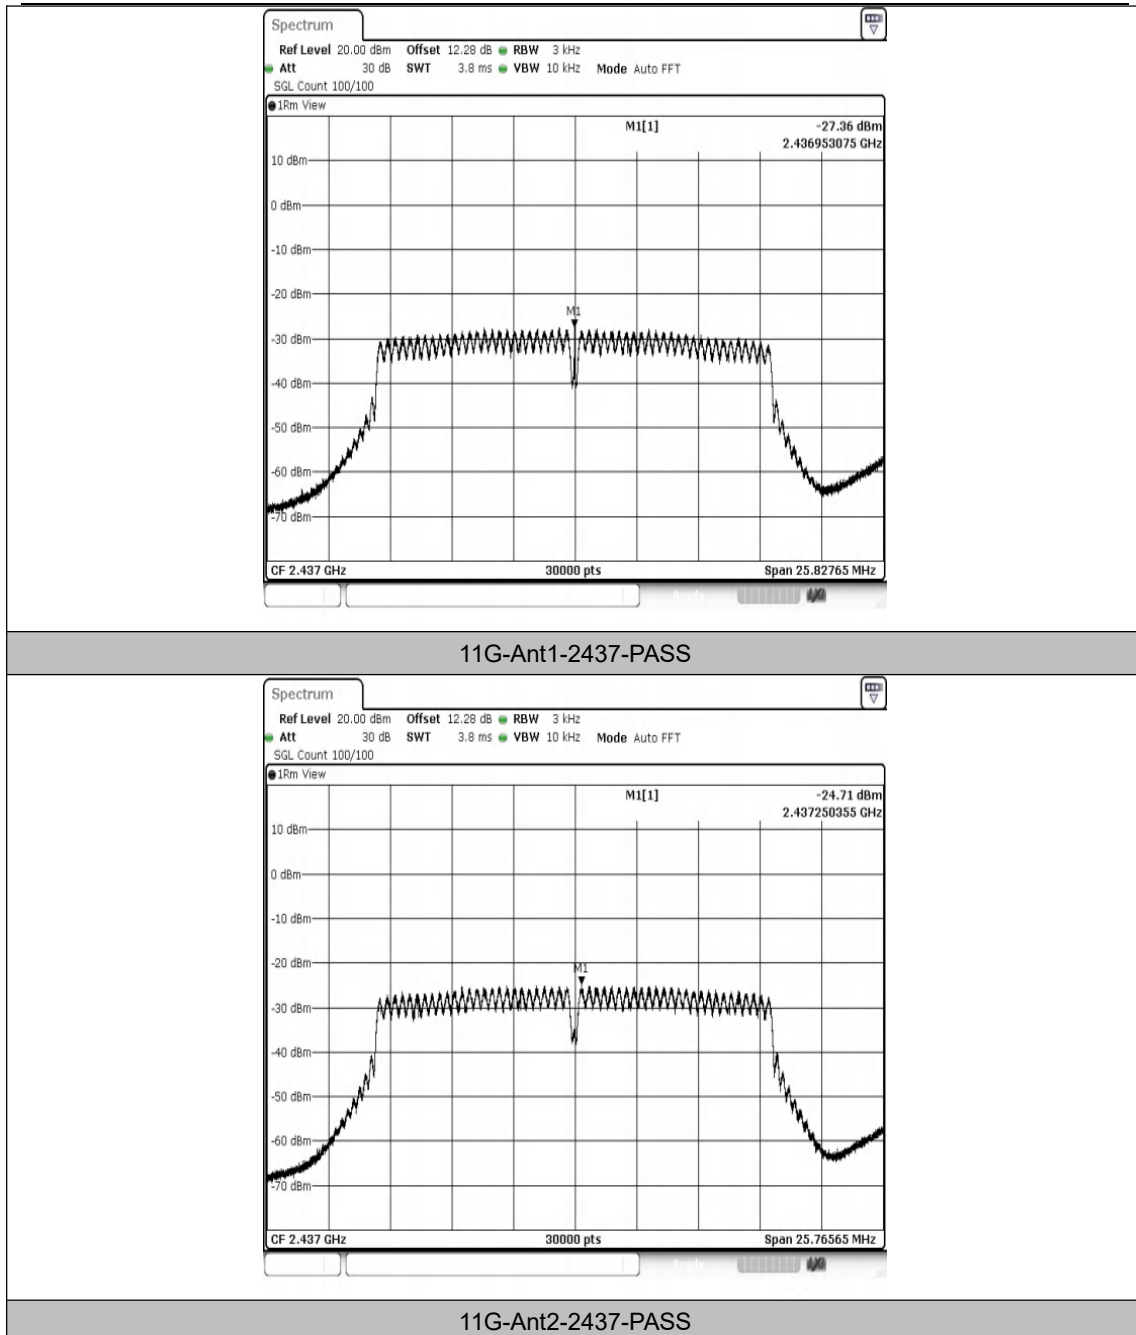

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

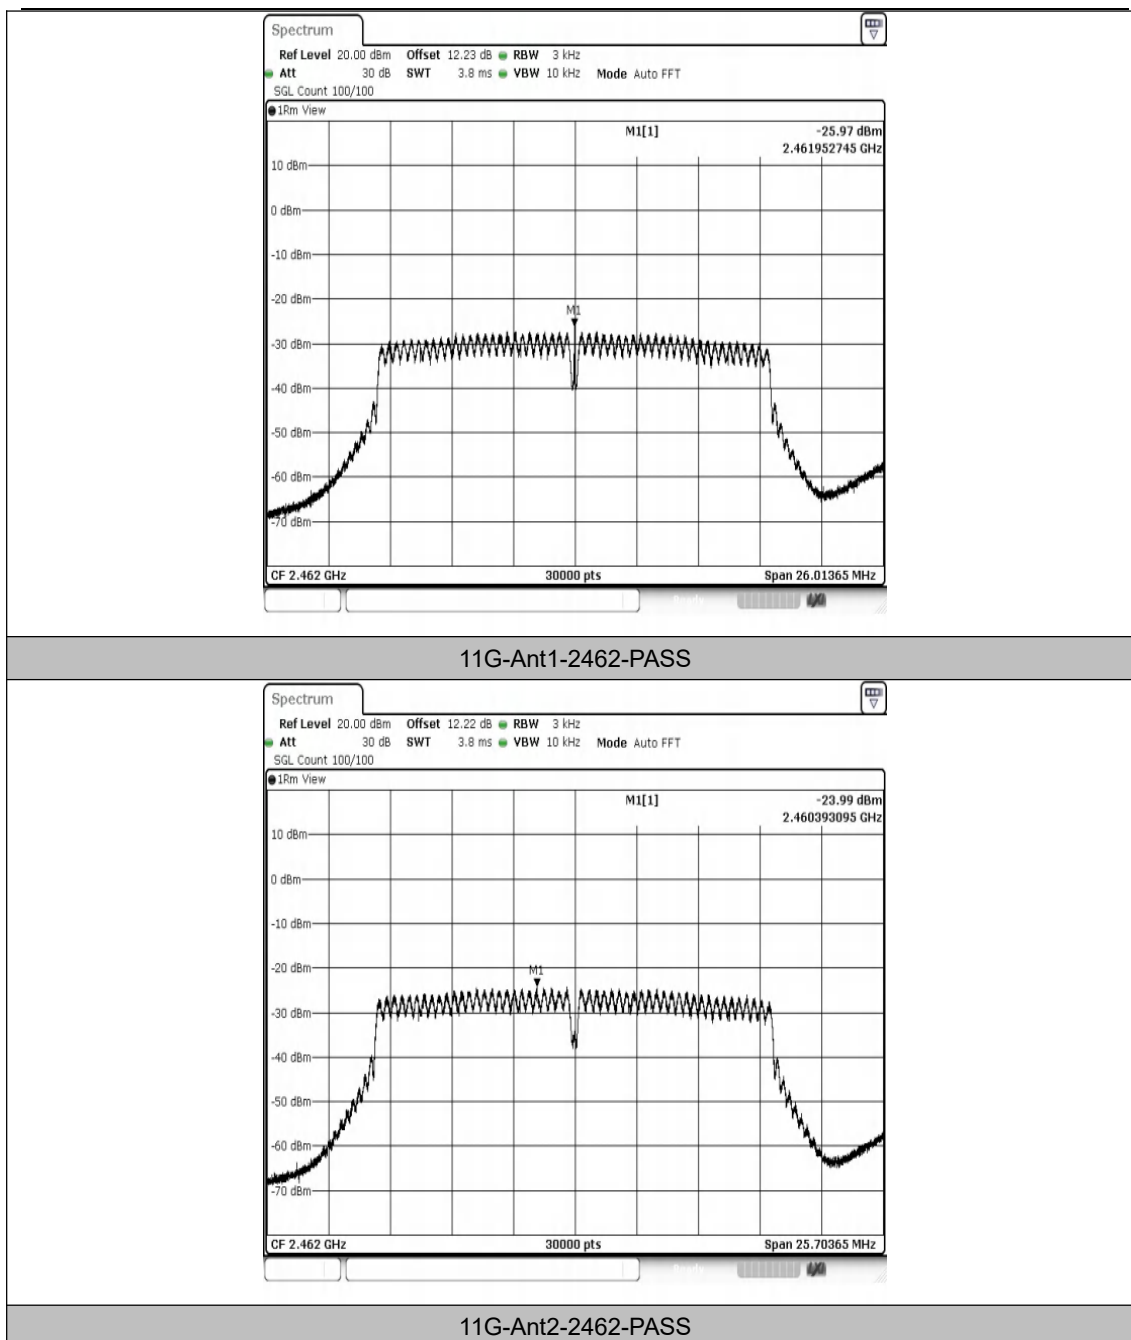


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

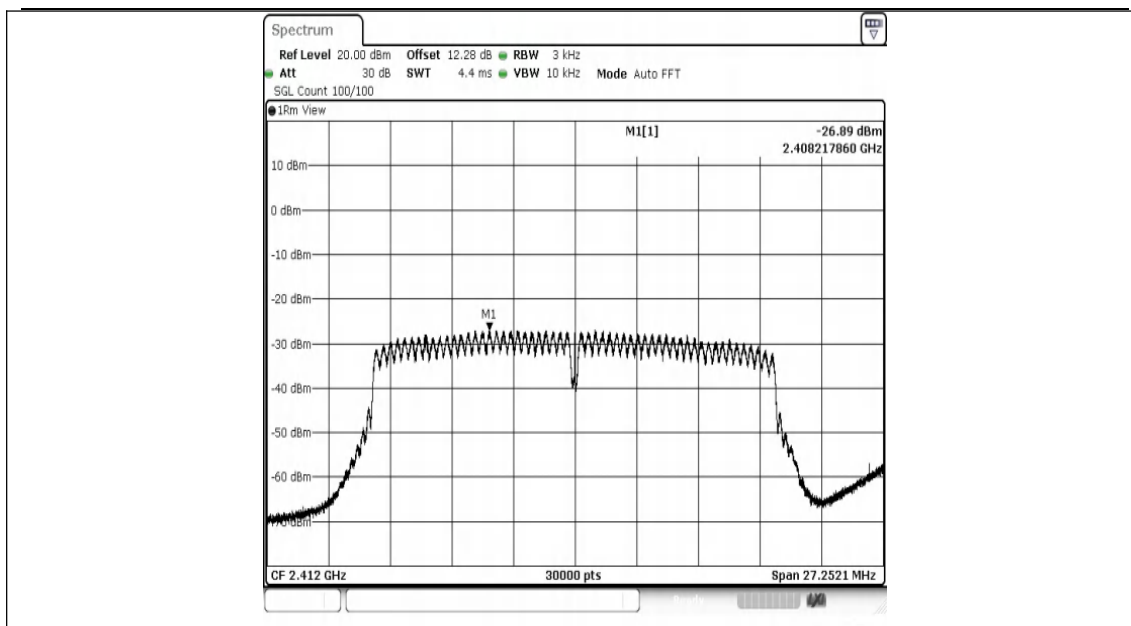


11N20MIMO-Ant1-2412-PASS

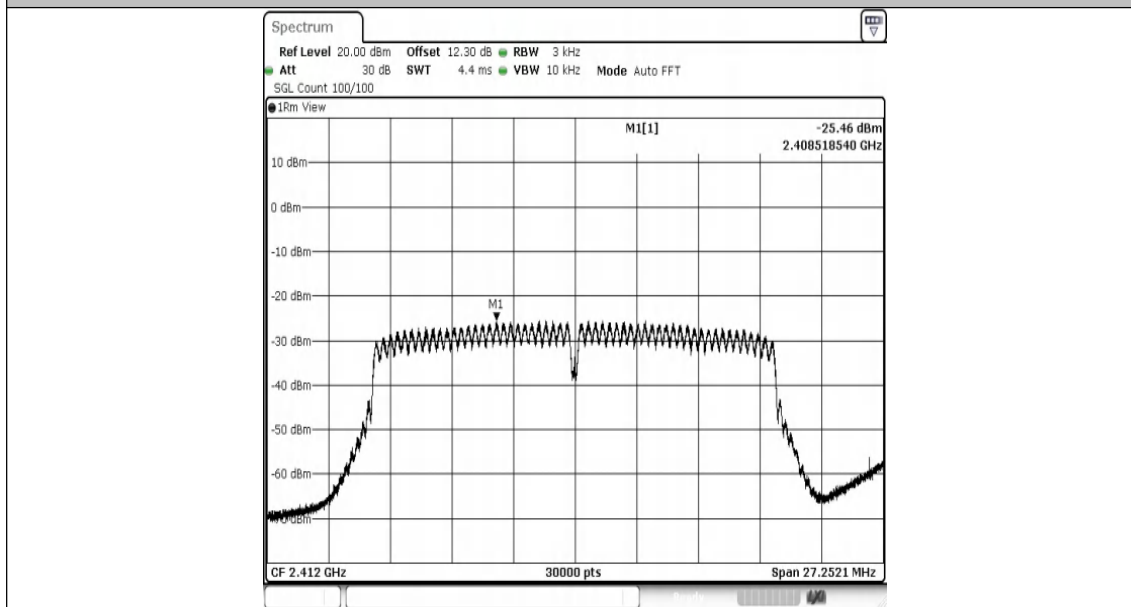


11N20MIMO-Ant2-2412-PASS

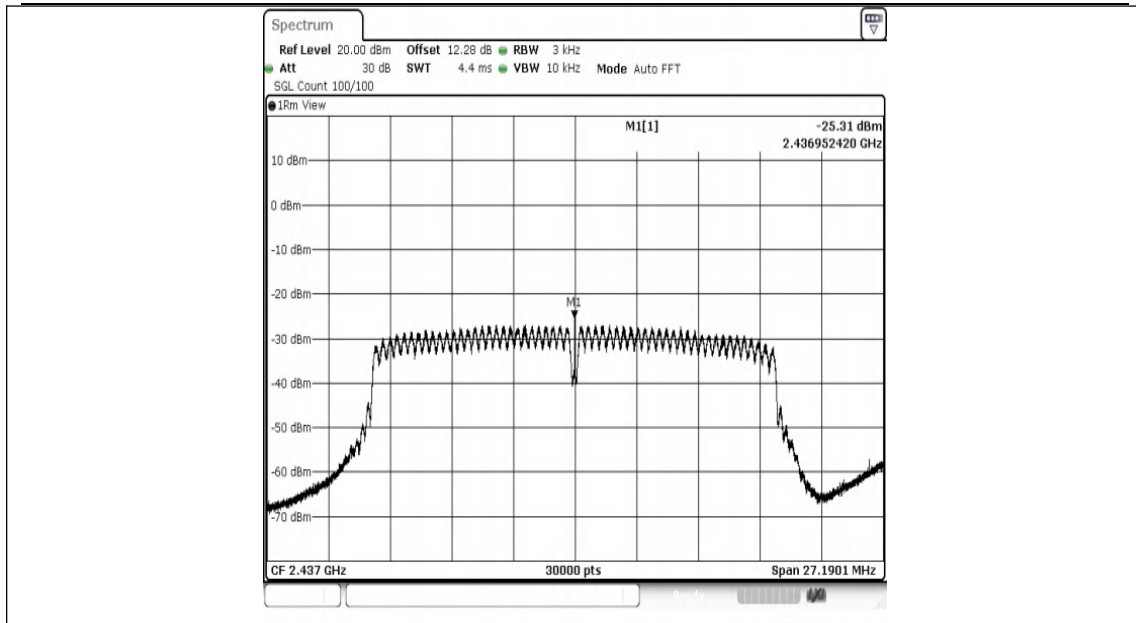


11N20MIMO-Ant1-2437-PASS

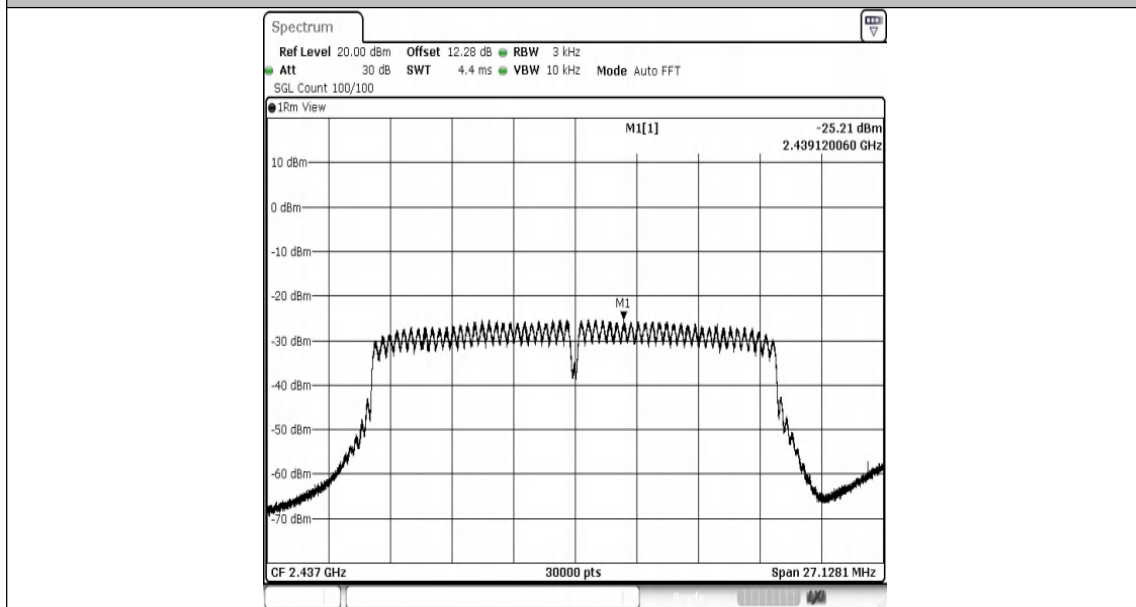


11N20MIMO-Ant2-2437-PASS

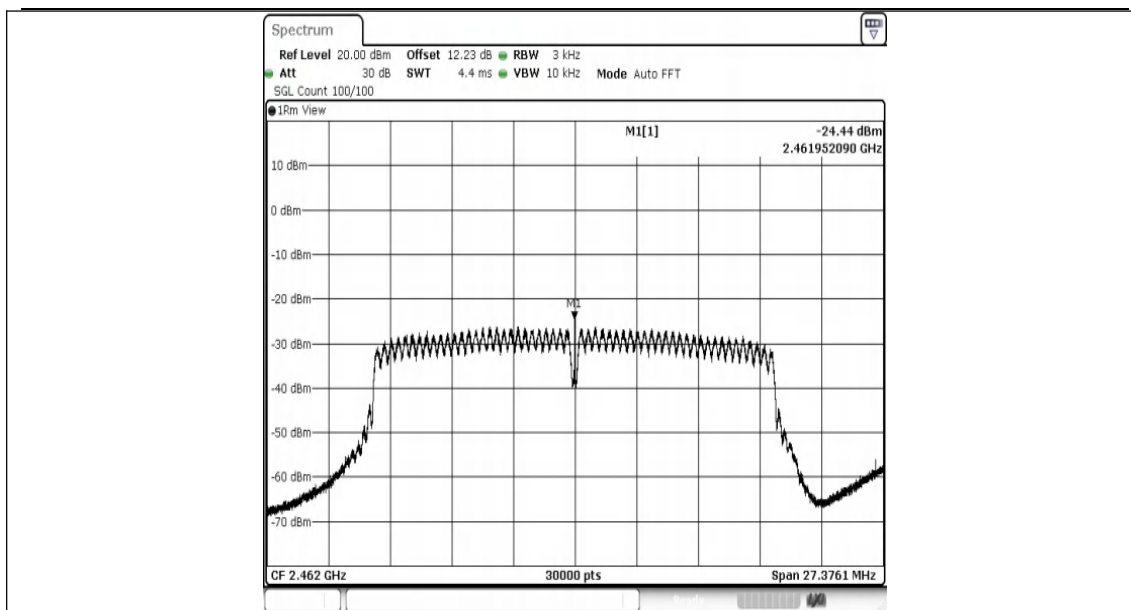


11N20MIMO-Ant1-2462-PASS

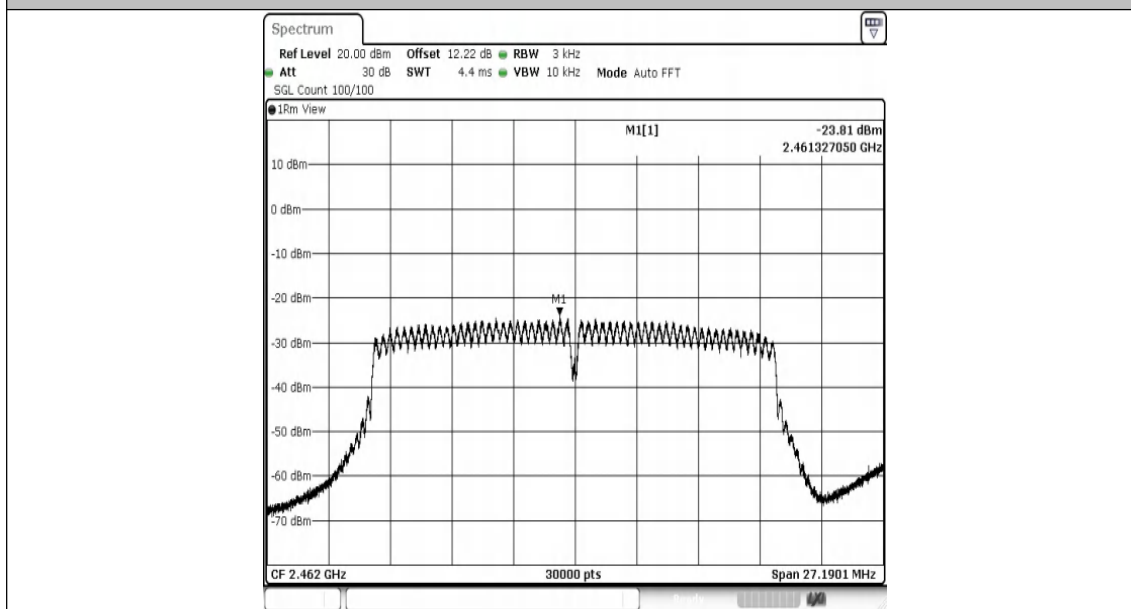


11N20MIMO-Ant2-2462-PASS

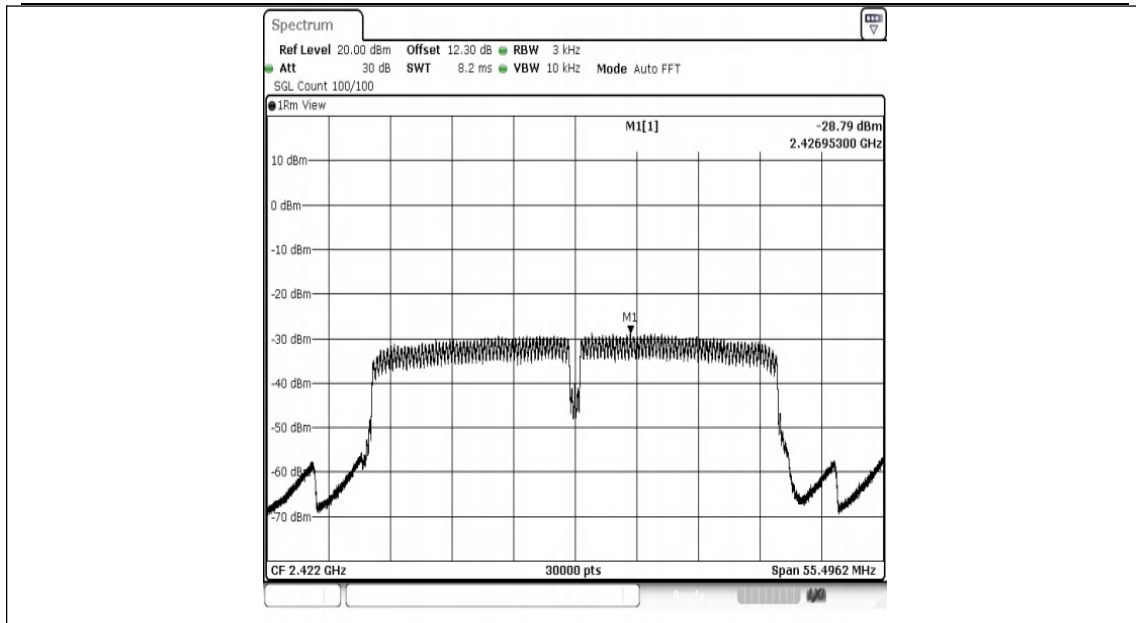


11N40MIMO-Ant2-2422-PASS

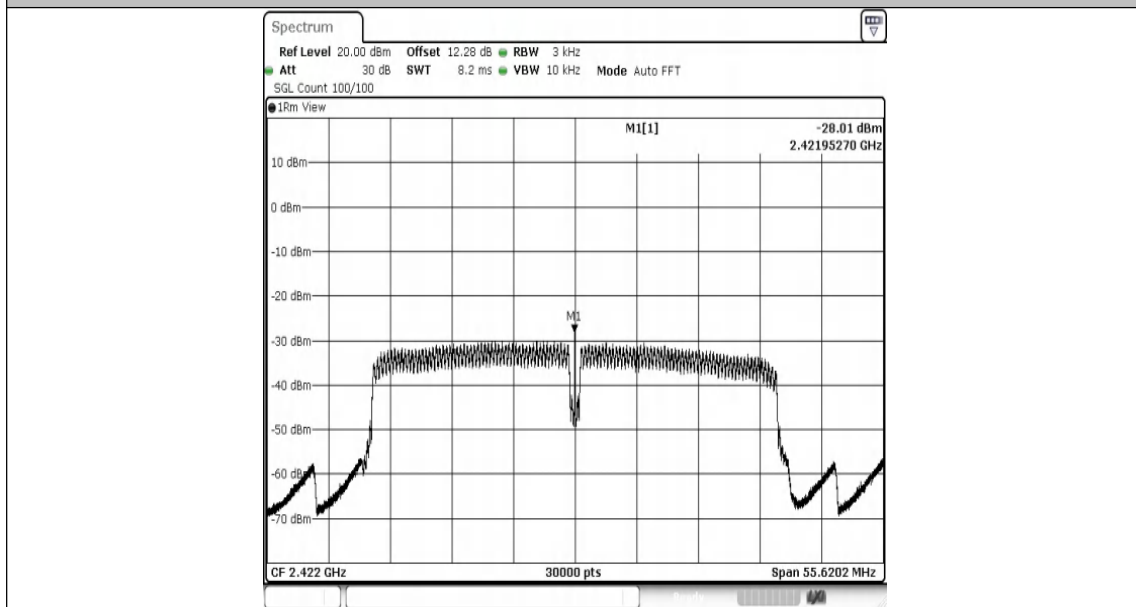


11N40MIMO-Ant1-2422-PASS

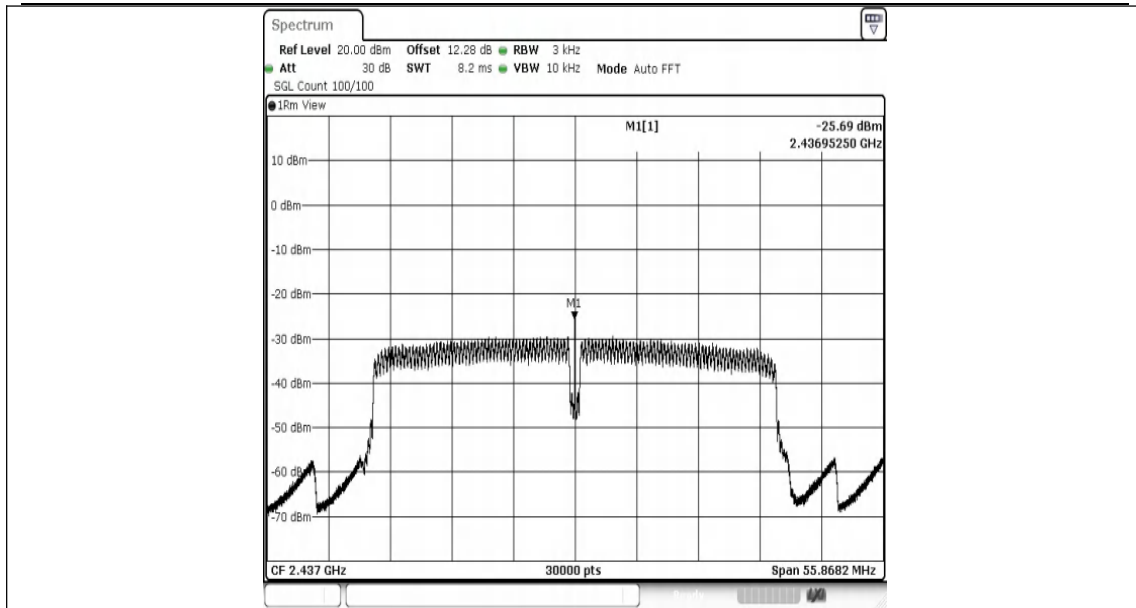


11N40MIMO-Ant1-2437-PASS

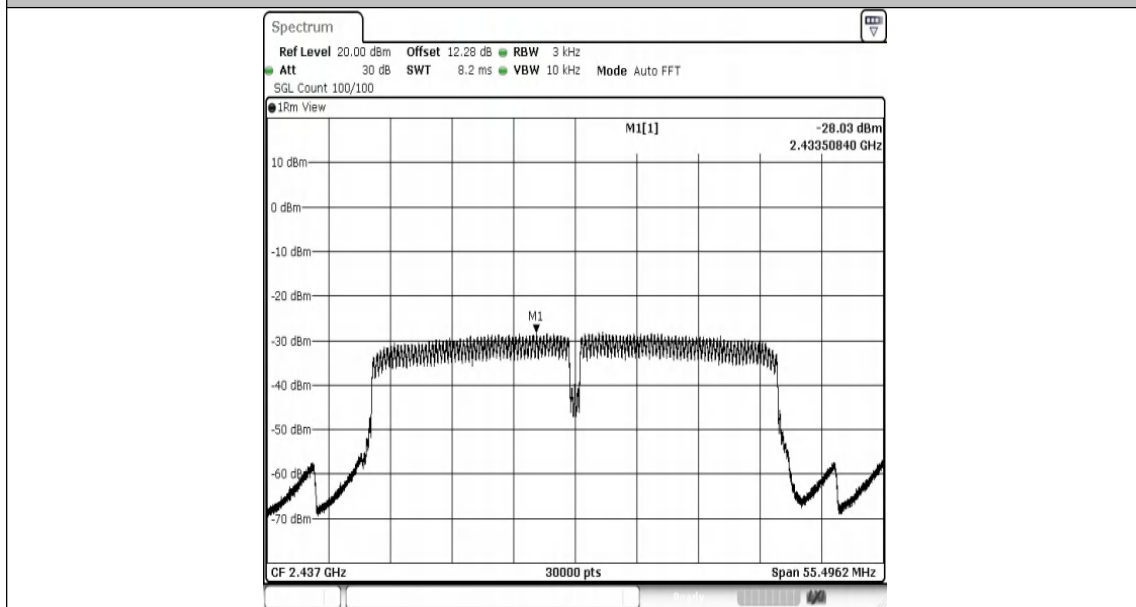


11N40MIMO-Ant2-2437-PASS

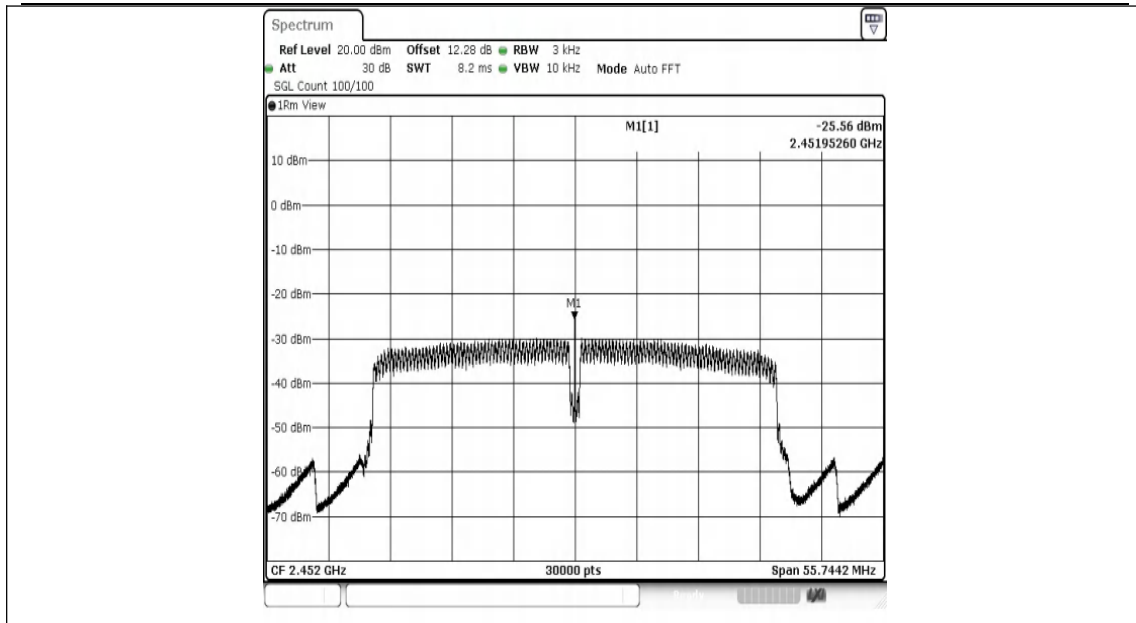


11N40MIMO-Ant1-2452-PASS

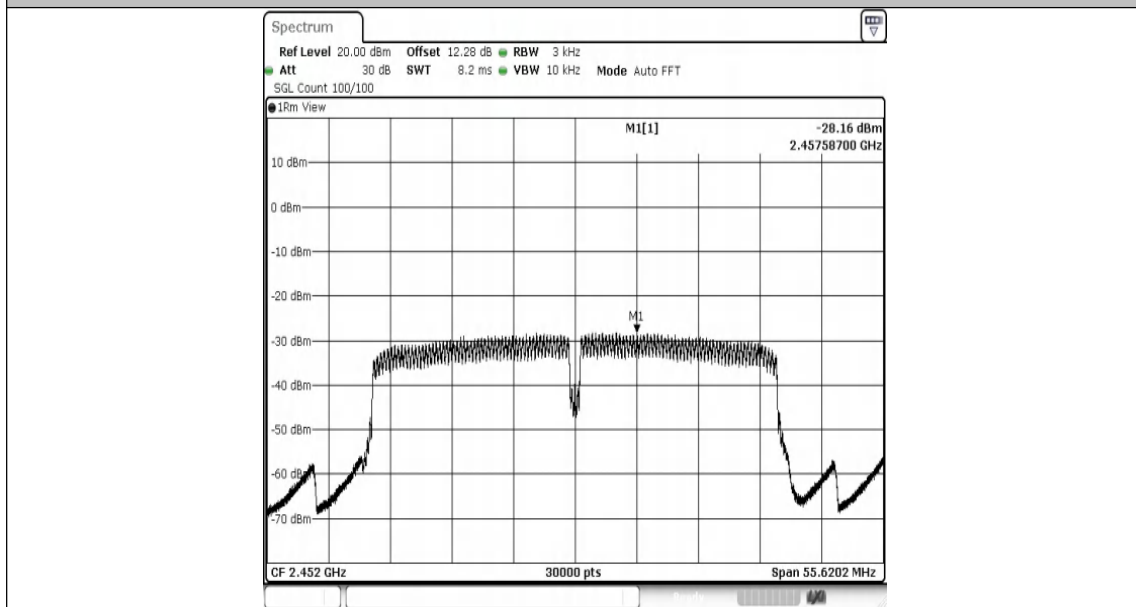

11N40MIMO-Ant2-2452-PASS

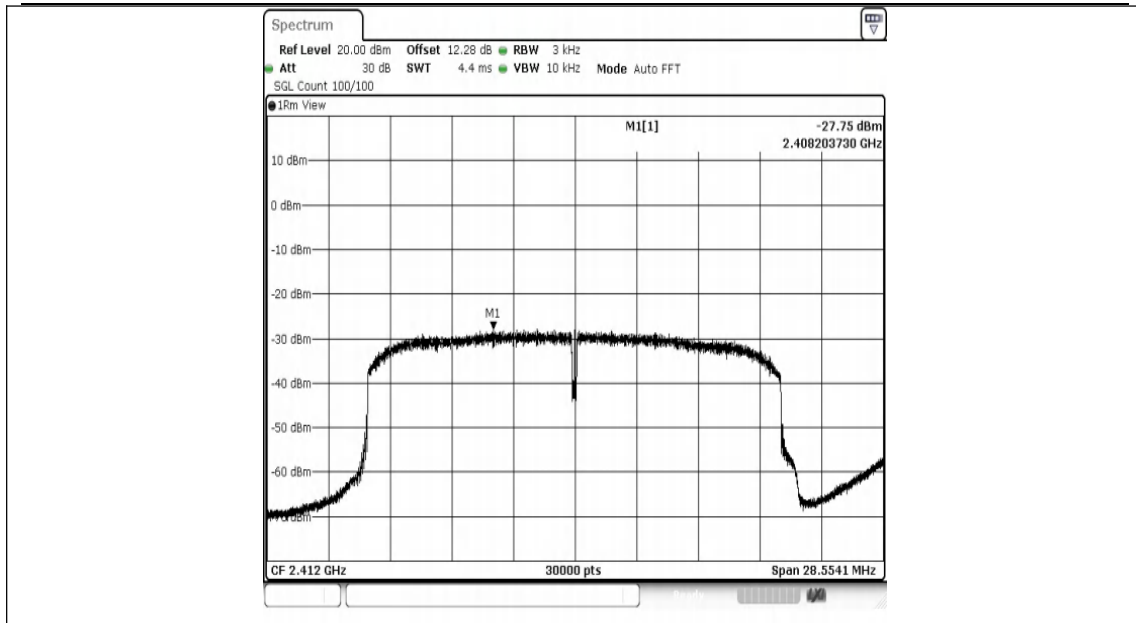

11AX20MIMO-Ant1-2412-PASS

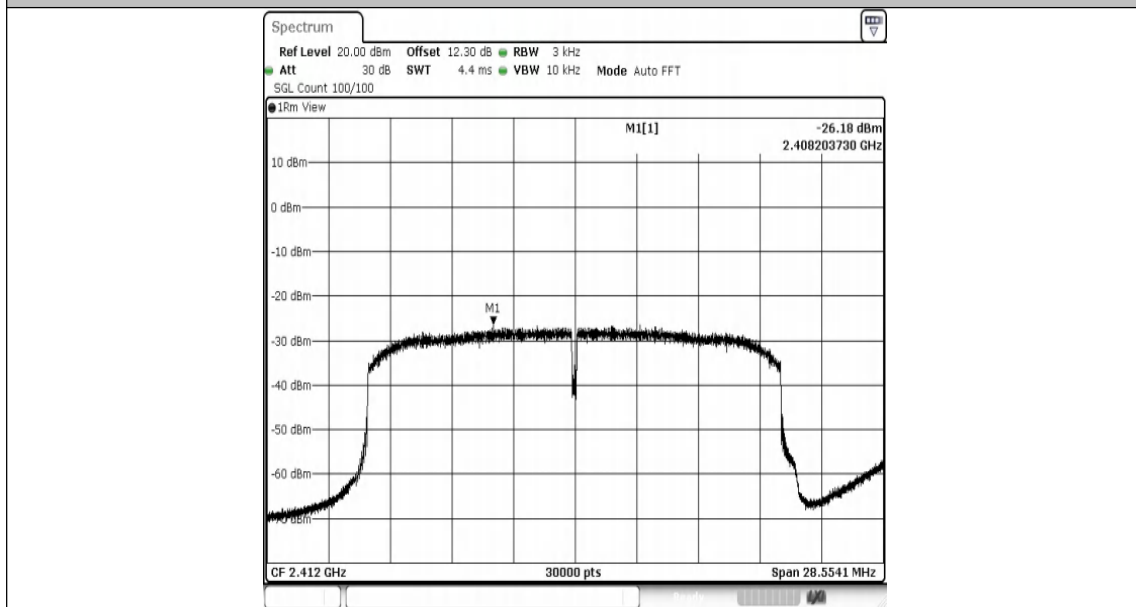


11AX20MIMO-Ant2-2412-PASS

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

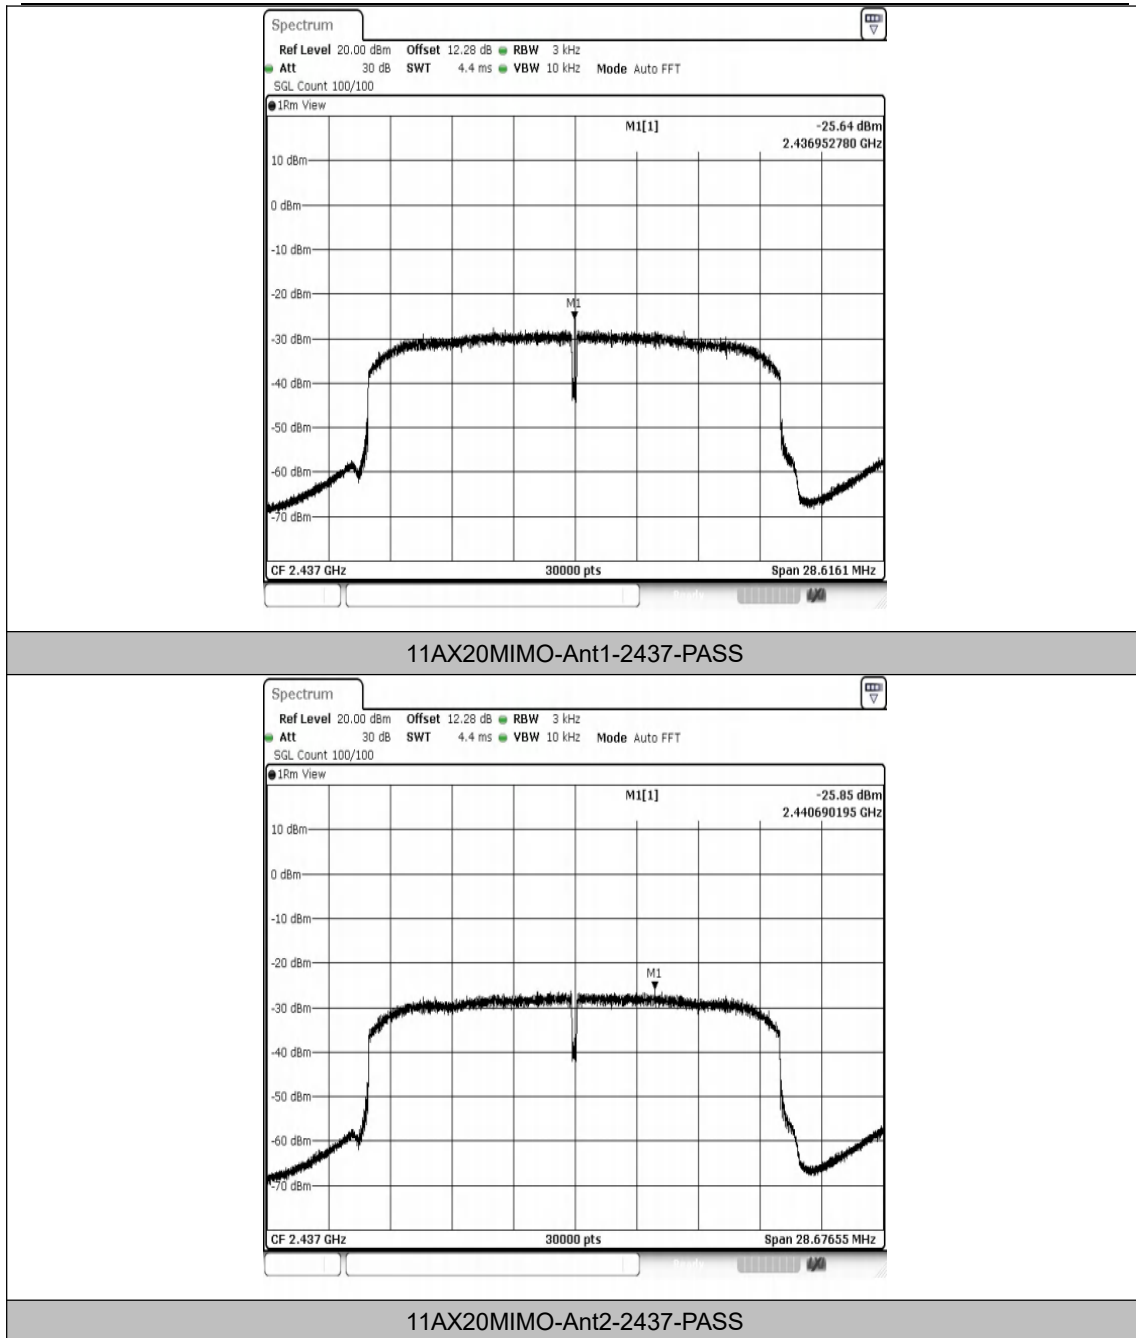

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.


Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

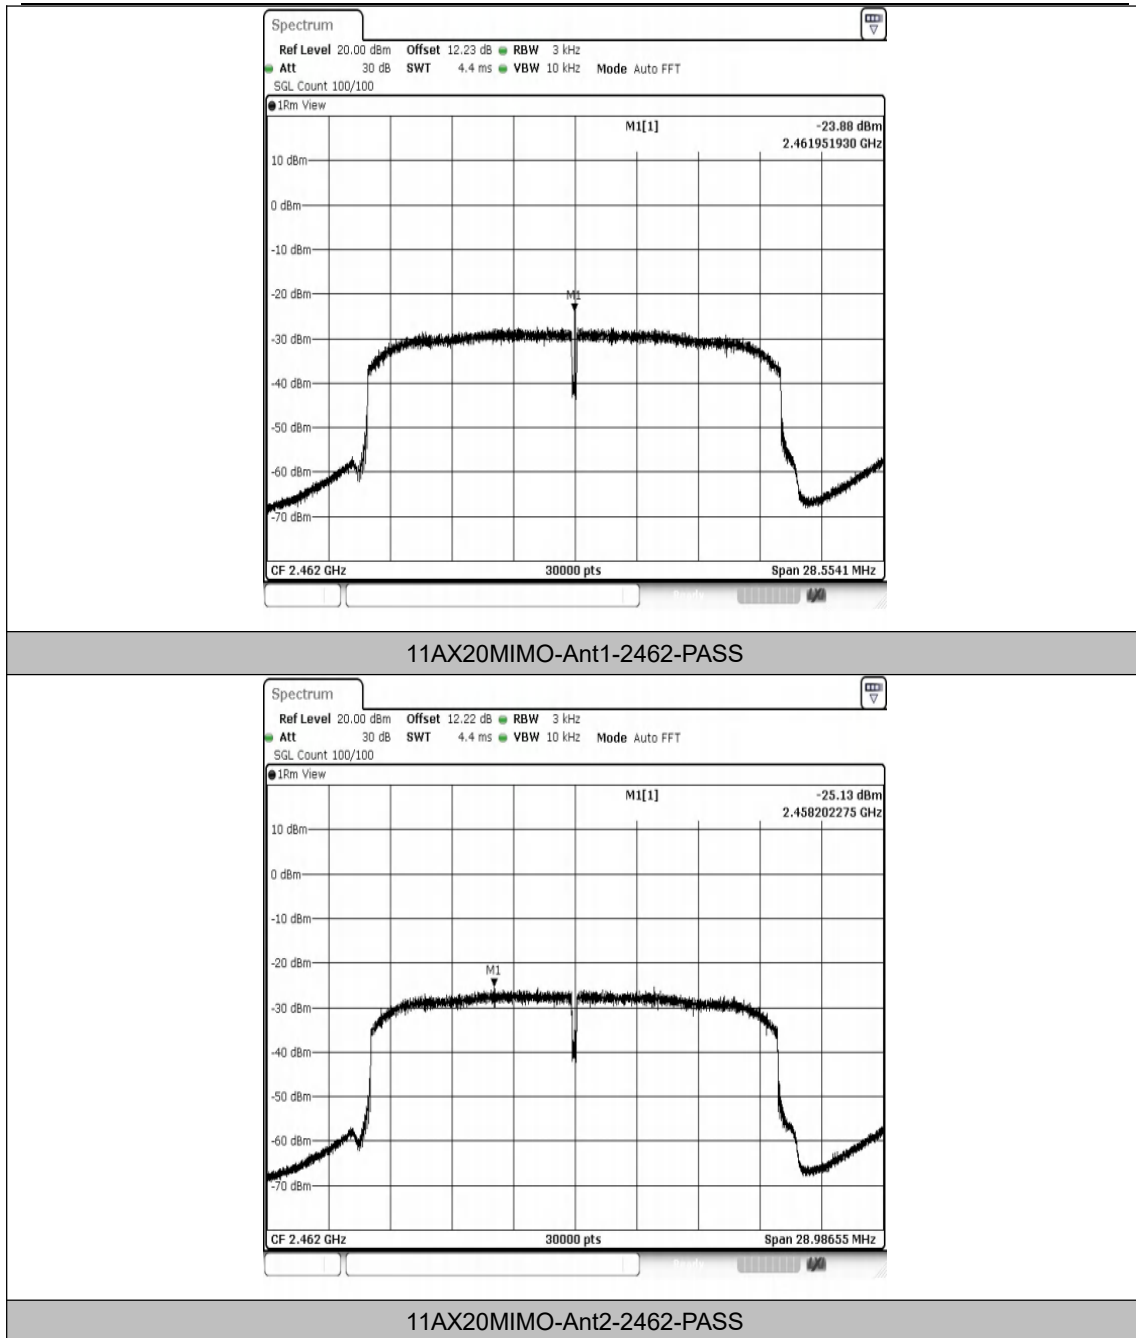


Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

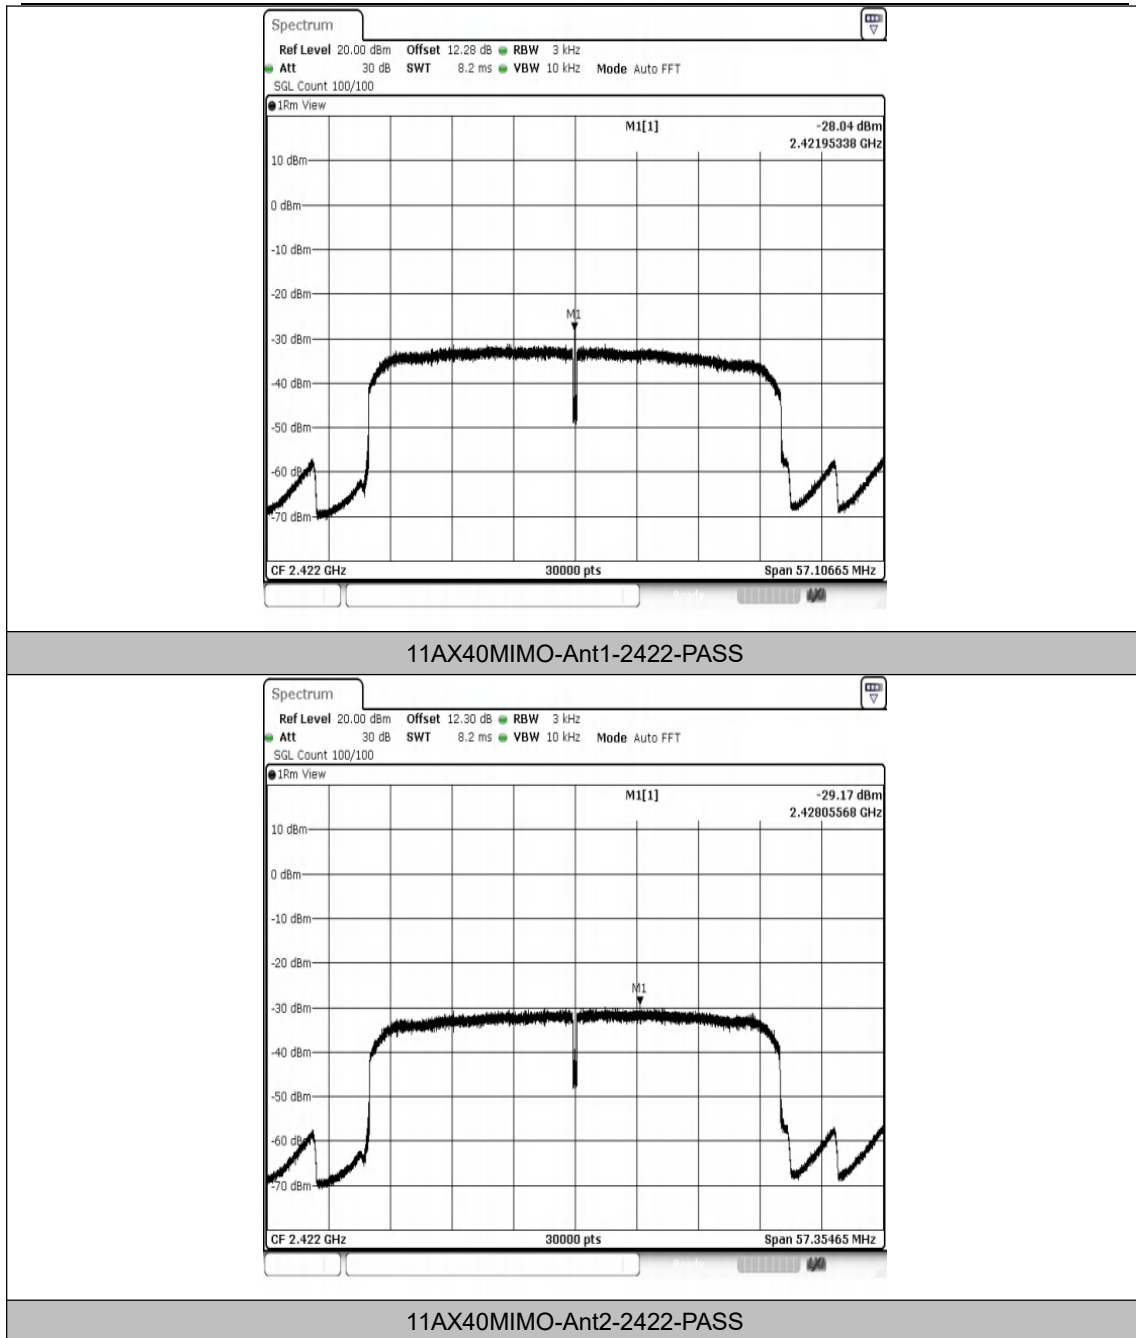


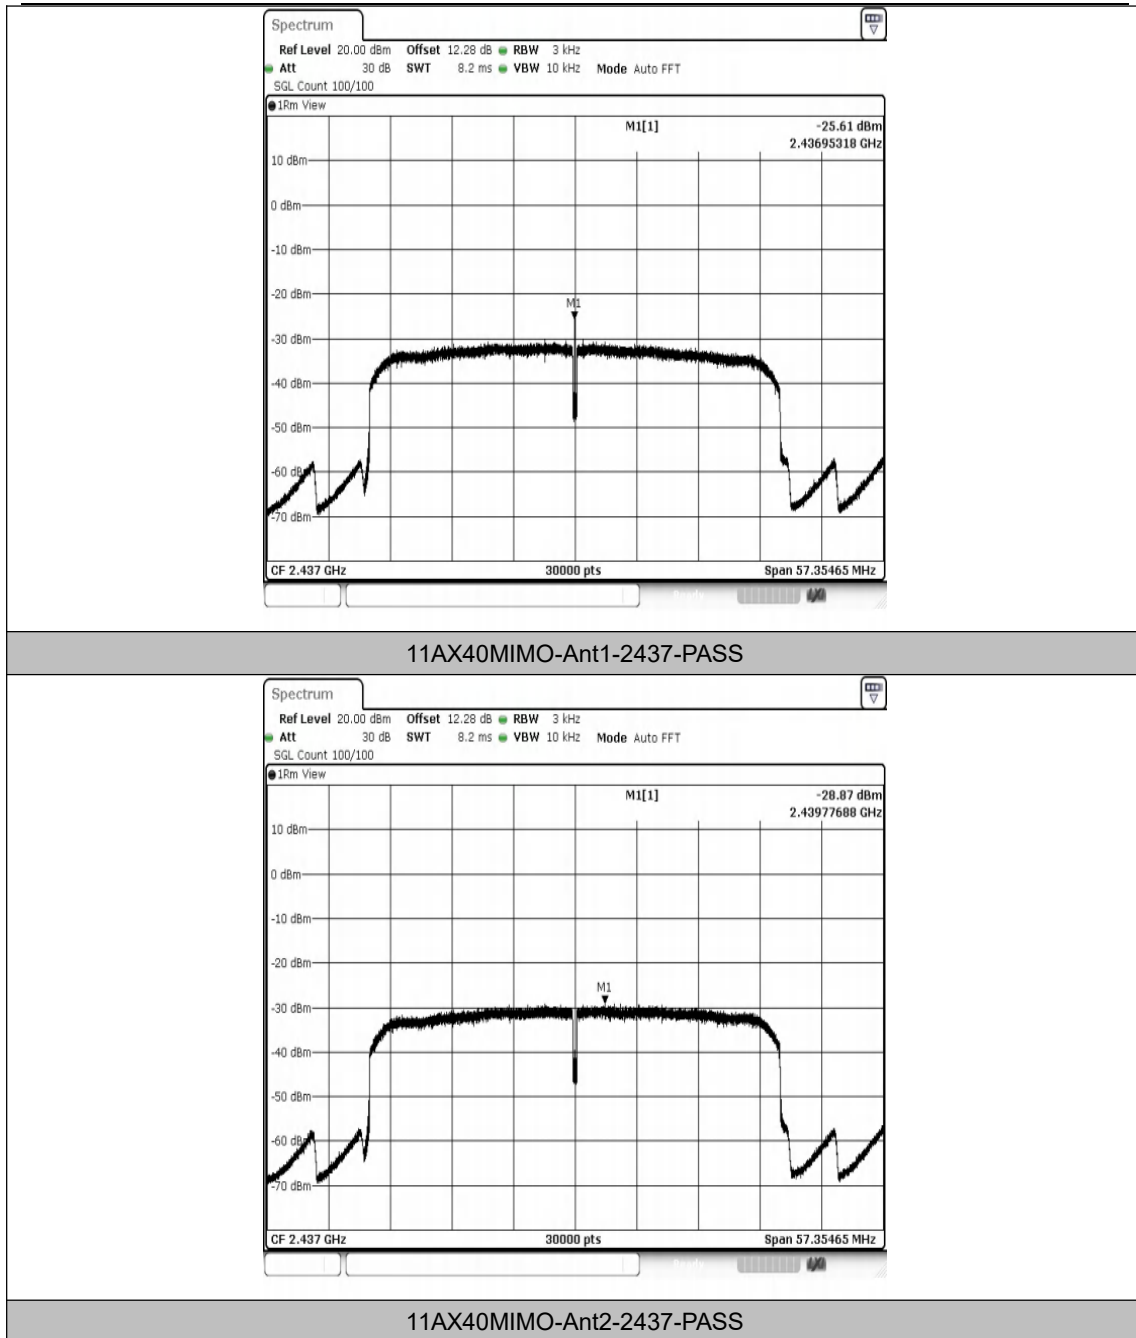

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

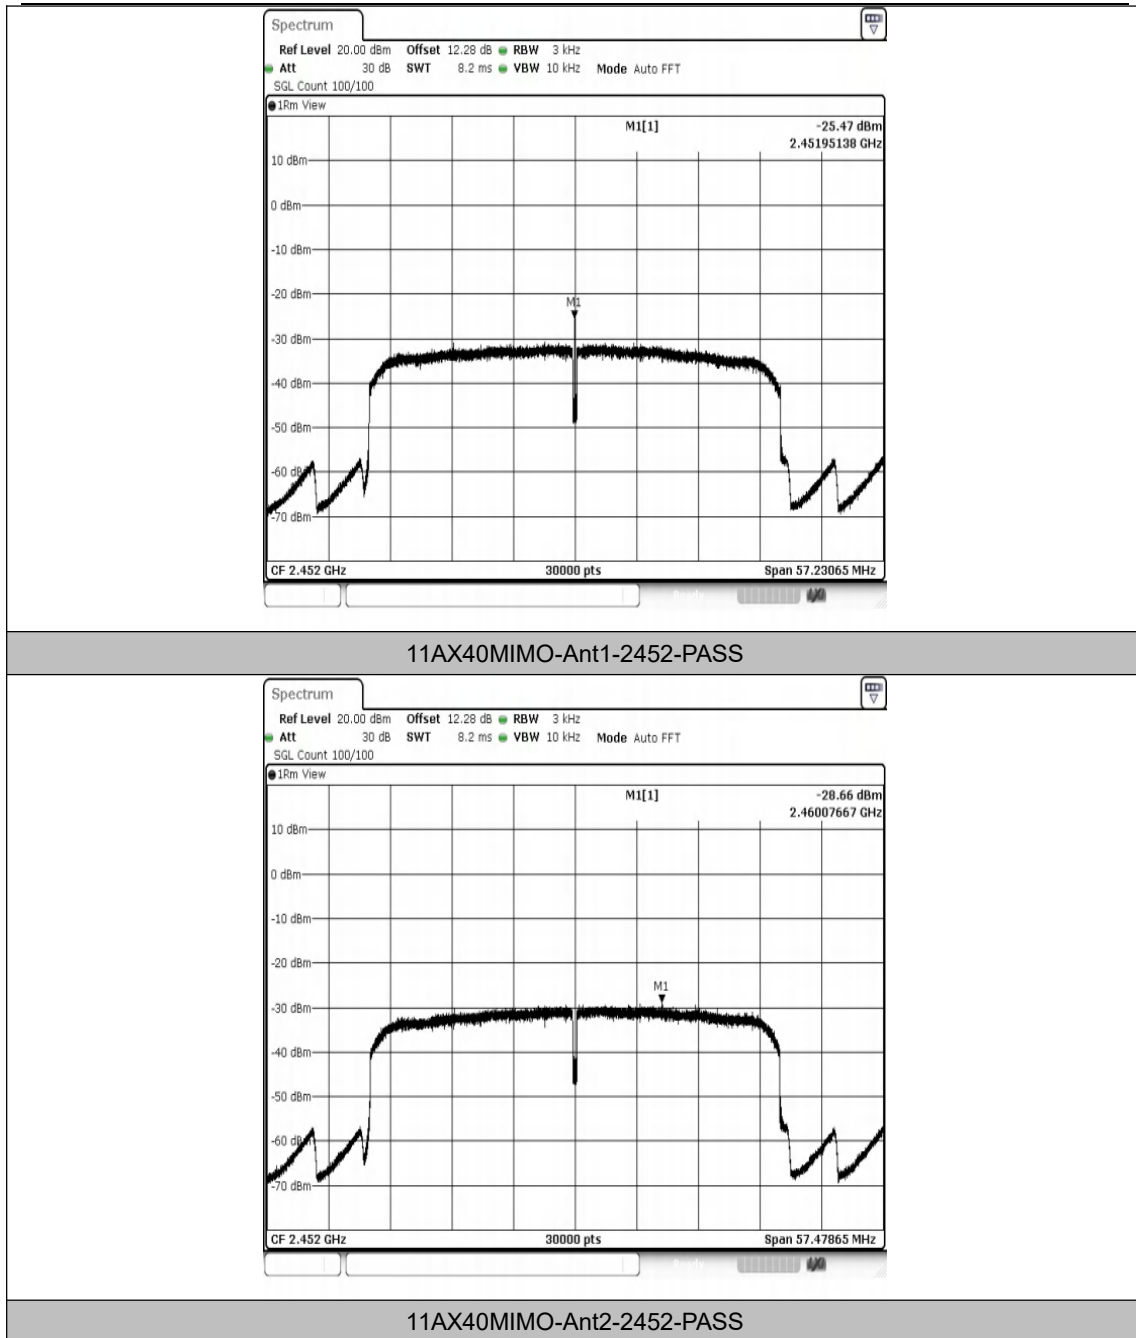


Appendix E: Conducted Band edge

Test Result

Test Mode	Antenna	Ch. Name	Frequency[MHz]	Ref. Level[dBm]	Result[dBm]	Limit[dBm]	Verdict
11B	Ant1	Low	2412	5.42	-45.7	≤-24.58	PASS
11B	Ant2	Low	2412	8.33	-42.35	≤-21.67	PASS
11B	Ant1	High	2462	5.96	-54.4	≤-24.04	PASS
11B	Ant2	High	2462	7.81	-51.26	≤-22.19	PASS
11G	Ant1	Low	2412	-5.07	-51.95	≤-35.07	PASS
11G	Ant2	Low	2412	-3.10	-50.34	≤-33.1	PASS
11G	Ant1	High	2462	-7.31	-55.01	≤-37.31	PASS
11G	Ant2	High	2462	-4.21	-47.04	≤-34.21	PASS
11N20MIMO	Ant1	Low	2412	-7.24	-52.2	≤-37.24	PASS
11N20MIMO	Ant2	Low	2412	-2.49	-51.48	≤-32.49	PASS
11N20MIMO	Ant1	High	2462	-6.43	-43.15	≤-36.43	PASS
11N20MIMO	Ant2	High	2462	-4.26	-51.86	≤-34.26	PASS
11N40MIMO	Ant1	Low	2422	-10.19	-52.48	≤-40.19	PASS
11N40MIMO	Ant2	Low	2422	-7.85	-49.13	≤-37.85	PASS
11N40MIMO	Ant1	High	2452	-9.93	-50.22	≤-39.93	PASS
11N40MIMO	Ant2	High	2452	-7.27	-49.28	≤-37.27	PASS
11AX20MIMO	Ant1	Low	2412	-5.50	-51.2	≤-35.5	PASS
11AX20MIMO	Ant2	Low	2412	-3.33	-52.74	≤-33.33	PASS
11AX20MIMO	Ant1	High	2462	-6.25	-54.39	≤-36.25	PASS
11AX20MIMO	Ant2	High	2462	-5.23	-53.34	≤-35.23	PASS
11AX40MIMO	Ant1	Low	2422	-8.79	-52.49	≤-38.79	PASS
11AX40MIMO	Ant2	Low	2422	-6.11	-47.94	≤-36.11	PASS
11AX40MIMO	Ant1	High	2452	-8.82	-54.7	≤-38.82	PASS
11AX40MIMO	Ant2	High	2452	-8.45	-52.85	≤-38.45	PASS

Remark:1. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.


Test Graphs

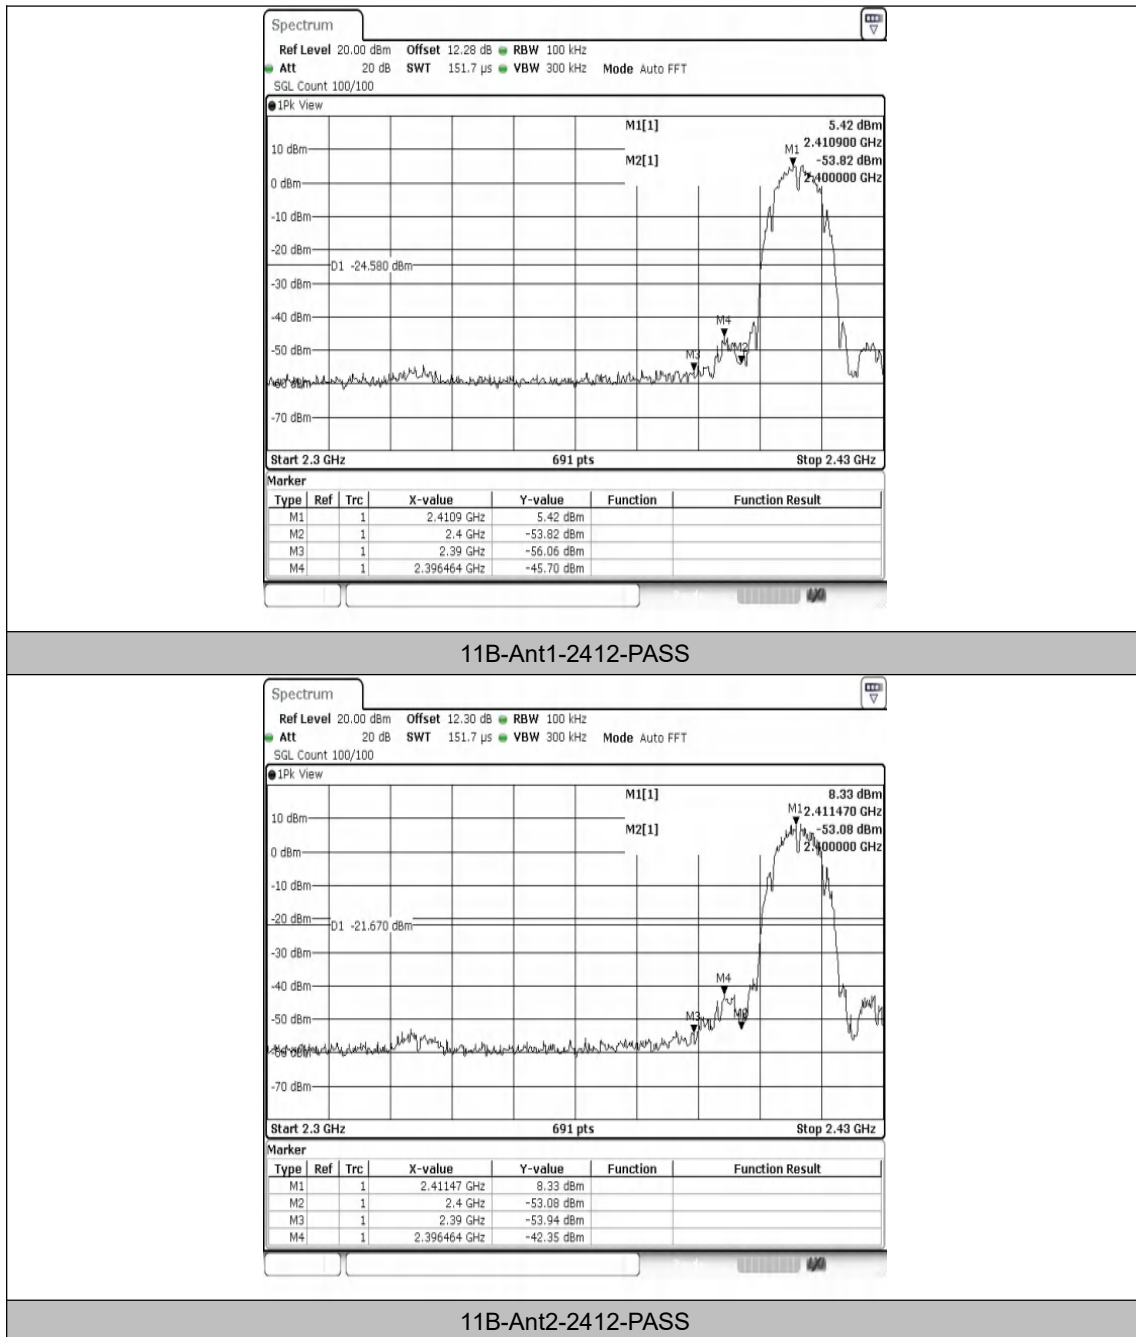



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

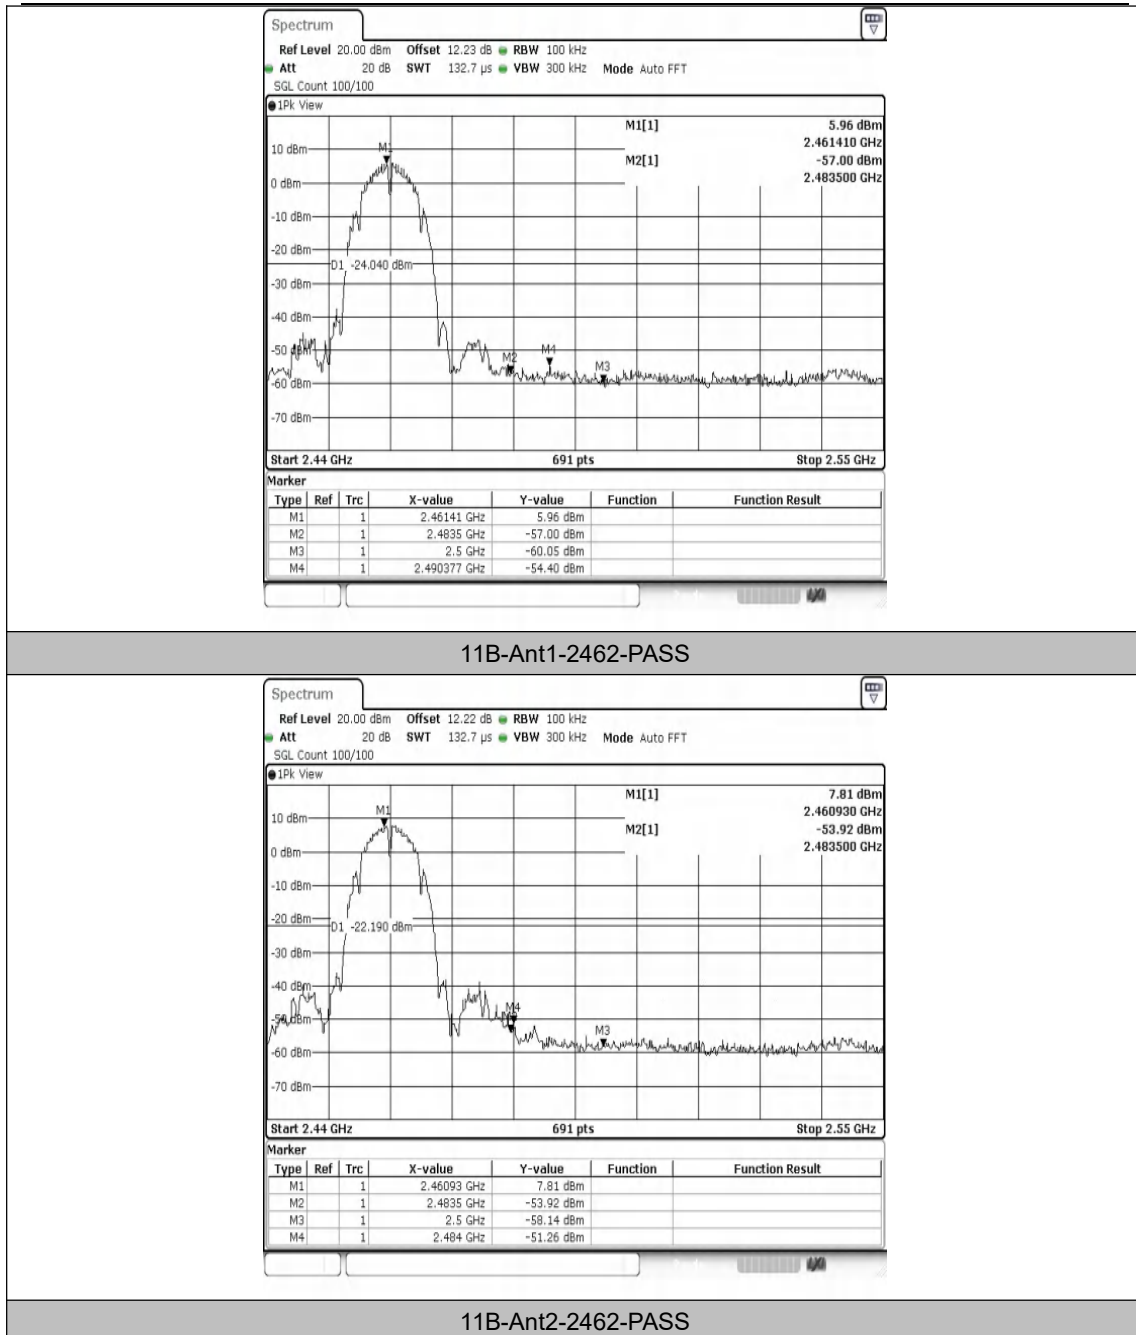

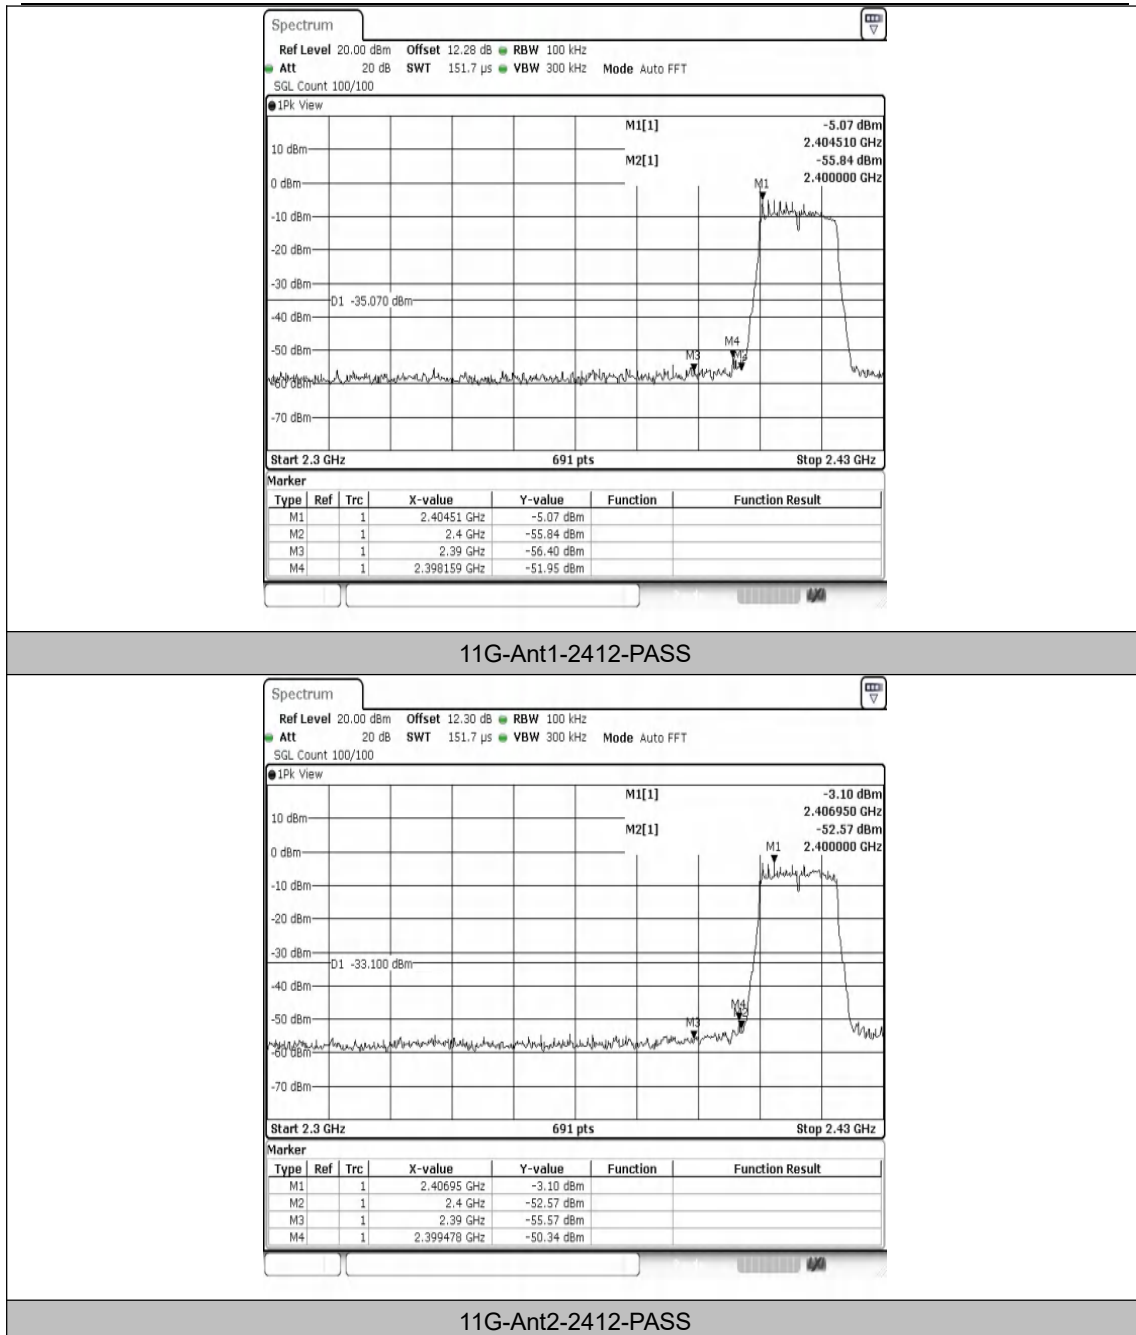

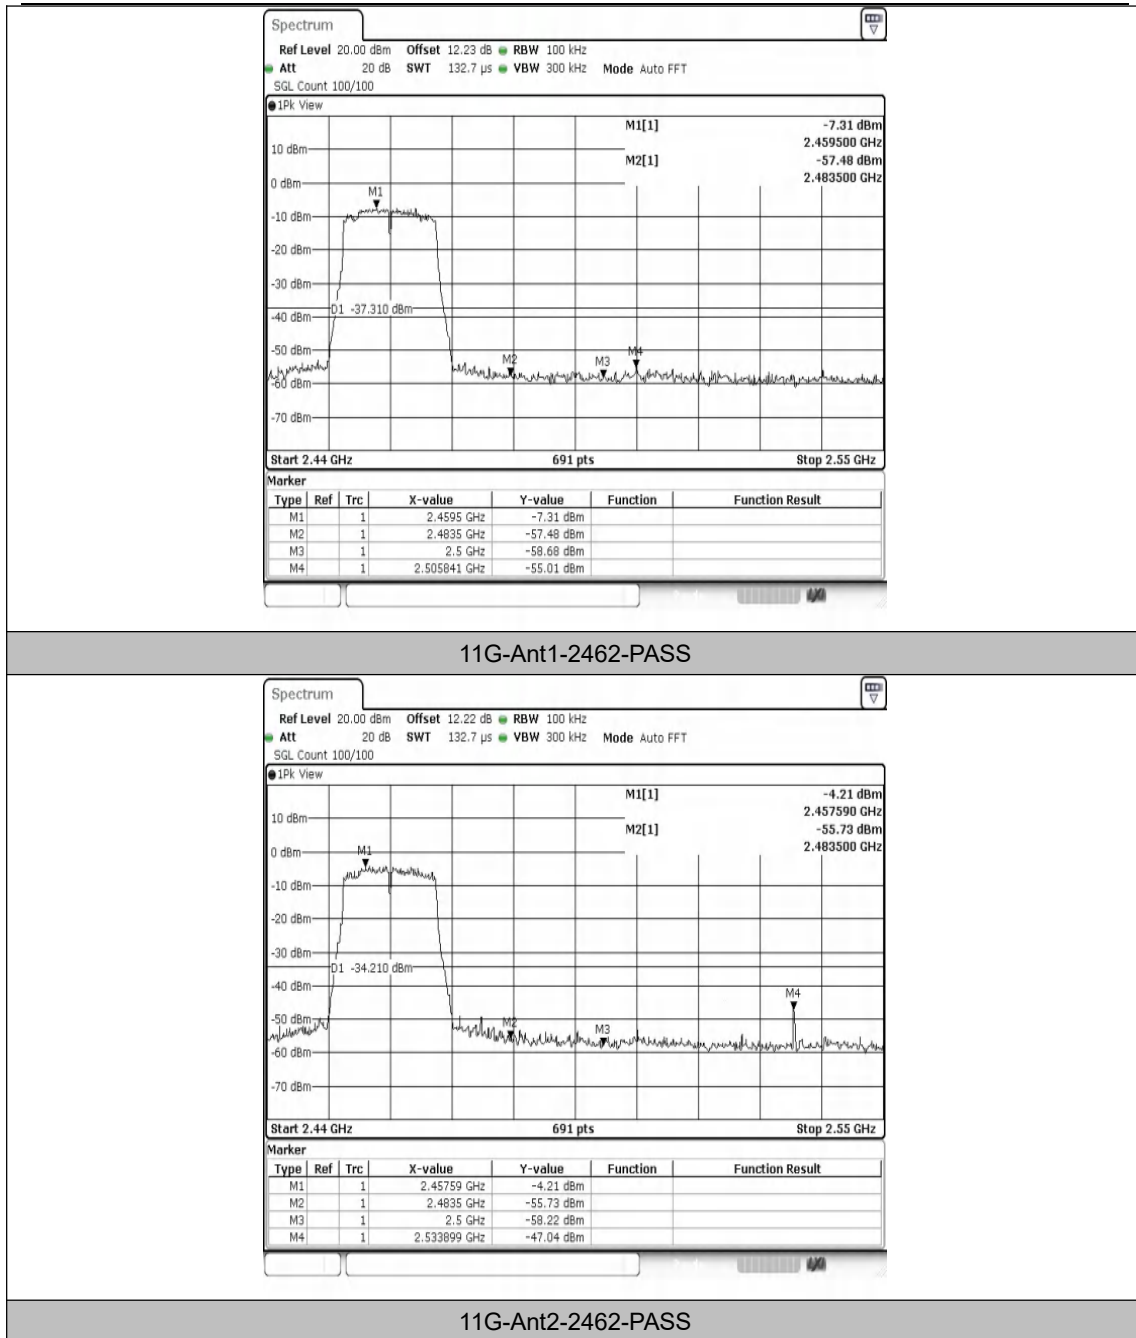

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com