

Band2	5MHz	16QAM	18900	1RB#0	3000~20000	-47.28	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.009~0.15	-58.80	PASS
Band2	5MHz	QPSK	19175	1RB#0	0.15~30	-58.88	PASS
Band2	5MHz	QPSK	19175	1RB#0	30~1000	-66.29	PASS
Band2	5MHz	QPSK	19175	1RB#0	1000~3000	-52.48	PASS
Band2	5MHz	QPSK	19175	1RB#0	3000~20000	-47.38	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.009~0.15	-63.62	PASS
Band2	5MHz	16QAM	19175	1RB#0	0.15~30	-59.38	PASS
Band2	5MHz	16QAM	19175	1RB#0	30~1000	-65.80	PASS
Band2	5MHz	16QAM	19175	1RB#0	1000~3000	-51.78	PASS
Band2	5MHz	16QAM	19175	1RB#0	3000~20000	-47.65	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.009~0.15	-60.65	PASS
Band2	10MHz	QPSK	18650	1RB#0	0.15~30	-57.83	PASS
Band2	10MHz	QPSK	18650	1RB#0	30~1000	-65.93	PASS
Band2	10MHz	QPSK	18650	1RB#0	1000~3000	-51.41	PASS
Band2	10MHz	QPSK	18650	1RB#0	3000~20000	-47.33	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.009~0.15	-63.41	PASS
Band2	10MHz	16QAM	18650	1RB#0	0.15~30	-58.05	PASS
Band2	10MHz	16QAM	18650	1RB#0	30~1000	-66.09	PASS
Band2	10MHz	16QAM	18650	1RB#0	1000~3000	-51.99	PASS
Band2	10MHz	16QAM	18650	1RB#0	3000~20000	-47.62	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.009~0.15	-62.19	PASS
Band2	10MHz	QPSK	18900	1RB#0	0.15~30	-56.72	PASS
Band2	10MHz	QPSK	18900	1RB#0	30~1000	-66.08	PASS
Band2	10MHz	QPSK	18900	1RB#0	1000~3000	-50.51	PASS
Band2	10MHz	QPSK	18900	1RB#0	3000~20000	-47.46	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.009~0.15	-62.12	PASS
Band2	10MHz	16QAM	18900	1RB#0	0.15~30	-58.70	PASS
Band2	10MHz	16QAM	18900	1RB#0	30~1000	-66.28	PASS
Band2	10MHz	16QAM	18900	1RB#0	1000~3000	-50.32	PASS
Band2	10MHz	16QAM	18900	1RB#0	3000~20000	-47.70	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.009~0.15	-60.36	PASS
Band2	10MHz	QPSK	19150	1RB#0	0.15~30	-60.13	PASS
Band2	10MHz	QPSK	19150	1RB#0	30~1000	-66.25	PASS
Band2	10MHz	QPSK	19150	1RB#0	1000~3000	-52.12	PASS
Band2	10MHz	QPSK	19150	1RB#0	3000~20000	-47.47	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.009~0.15	-58.72	PASS
Band2	10MHz	16QAM	19150	1RB#0	0.15~30	-56.65	PASS
Band2	10MHz	16QAM	19150	1RB#0	30~1000	-66.06	PASS
Band2	10MHz	16QAM	19150	1RB#0	1000~3000	-52.06	PASS
Band2	10MHz	16QAM	19150	1RB#0	3000~20000	-47.45	PASS
Band2	15MHz	QPSK	18675	1RB#0	0.009~0.15	-63.47	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	15MHz	QPSK	18675	1RB#0	0.15~30	-56.89	PASS
Band2	15MHz	QPSK	18675	1RB#0	30~1000	-66.25	PASS
Band2	15MHz	QPSK	18675	1RB#0	1000~3000	-52.54	PASS
Band2	15MHz	QPSK	18675	1RB#0	3000~20000	-47.40	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.009~0.15	-62.42	PASS
Band2	15MHz	16QAM	18675	1RB#0	0.15~30	-56.14	PASS
Band2	15MHz	16QAM	18675	1RB#0	30~1000	-66.02	PASS
Band2	15MHz	16QAM	18675	1RB#0	1000~3000	-52.30	PASS
Band2	15MHz	16QAM	18675	1RB#0	3000~20000	-47.58	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.009~0.15	-62.22	PASS
Band2	15MHz	QPSK	18900	1RB#0	0.15~30	-58.64	PASS
Band2	15MHz	QPSK	18900	1RB#0	30~1000	-66.14	PASS
Band2	15MHz	QPSK	18900	1RB#0	1000~3000	-51.74	PASS
Band2	15MHz	QPSK	18900	1RB#0	3000~20000	-47.16	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.009~0.15	-62.14	PASS
Band2	15MHz	16QAM	18900	1RB#0	0.15~30	-56.71	PASS
Band2	15MHz	16QAM	18900	1RB#0	30~1000	-65.68	PASS
Band2	15MHz	16QAM	18900	1RB#0	1000~3000	-44.63	PASS
Band2	15MHz	16QAM	18900	1RB#0	3000~20000	-47.20	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.009~0.15	-57.27	PASS
Band2	15MHz	QPSK	19125	1RB#0	0.15~30	-58.02	PASS
Band2	15MHz	QPSK	19125	1RB#0	30~1000	-65.83	PASS
Band2	15MHz	QPSK	19125	1RB#0	1000~3000	-45.79	PASS
Band2	15MHz	QPSK	19125	1RB#0	3000~20000	-47.36	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.009~0.15	-61.92	PASS
Band2	15MHz	16QAM	19125	1RB#0	0.15~30	-55.75	PASS
Band2	15MHz	16QAM	19125	1RB#0	30~1000	-66.32	PASS
Band2	15MHz	16QAM	19125	1RB#0	1000~3000	-52.02	PASS
Band2	15MHz	16QAM	19125	1RB#0	3000~20000	-46.71	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.009~0.15	-61.19	PASS
Band2	20MHz	QPSK	18700	1RB#0	0.15~30	-55.37	PASS
Band2	20MHz	QPSK	18700	1RB#0	30~1000	-66.23	PASS
Band2	20MHz	QPSK	18700	1RB#0	1000~3000	-46.94	PASS
Band2	20MHz	QPSK	18700	1RB#0	3000~20000	-47.33	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.009~0.15	-63.41	PASS
Band2	20MHz	16QAM	18700	1RB#0	0.15~30	-58.00	PASS
Band2	20MHz	16QAM	18700	1RB#0	30~1000	-66.19	PASS
Band2	20MHz	16QAM	18700	1RB#0	1000~3000	-51.52	PASS
Band2	20MHz	16QAM	18700	1RB#0	3000~20000	-47.49	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.009~0.15	-60.24	PASS
Band2	20MHz	QPSK	18900	1RB#0	0.15~30	-58.07	PASS
Band2	20MHz	QPSK	18900	1RB#0	30~1000	-65.83	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500


www.anbotek.com




Band2	20MHz	QPSK	18900	1RB#0	1000~3000	-52.11	PASS
Band2	20MHz	QPSK	18900	1RB#0	3000~20000	-46.91	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.009~0.15	-60.13	PASS
Band2	20MHz	16QAM	18900	1RB#0	0.15~30	-58.82	PASS
Band2	20MHz	16QAM	18900	1RB#0	30~1000	-66.19	PASS
Band2	20MHz	16QAM	18900	1RB#0	1000~3000	-51.98	PASS
Band2	20MHz	16QAM	18900	1RB#0	3000~20000	-47.52	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.009~0.15	-60.48	PASS
Band2	20MHz	QPSK	19100	1RB#0	0.15~30	-55.88	PASS
Band2	20MHz	QPSK	19100	1RB#0	30~1000	-66.16	PASS
Band2	20MHz	QPSK	19100	1RB#0	1000~3000	-51.18	PASS
Band2	20MHz	QPSK	19100	1RB#0	3000~20000	-47.21	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.009~0.15	-61.50	PASS
Band2	20MHz	16QAM	19100	1RB#0	0.15~30	-59.17	PASS
Band2	20MHz	16QAM	19100	1RB#0	30~1000	-66.07	PASS
Band2	20MHz	16QAM	19100	1RB#0	1000~3000	-52.40	PASS
Band2	20MHz	16QAM	19100	1RB#0	3000~20000	-47.34	PASS

Test Graphs

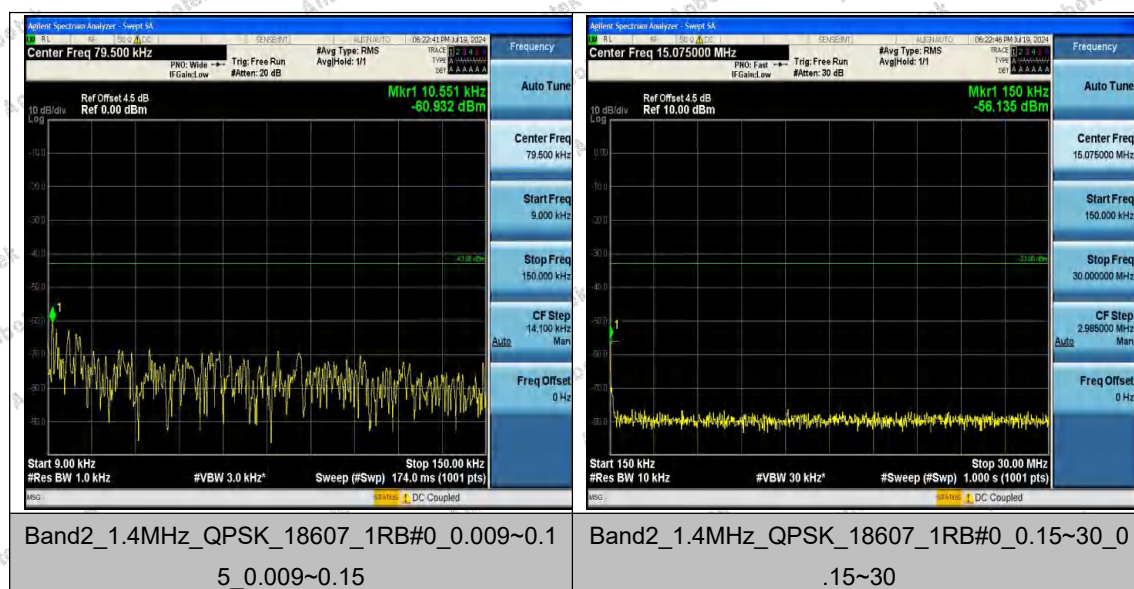


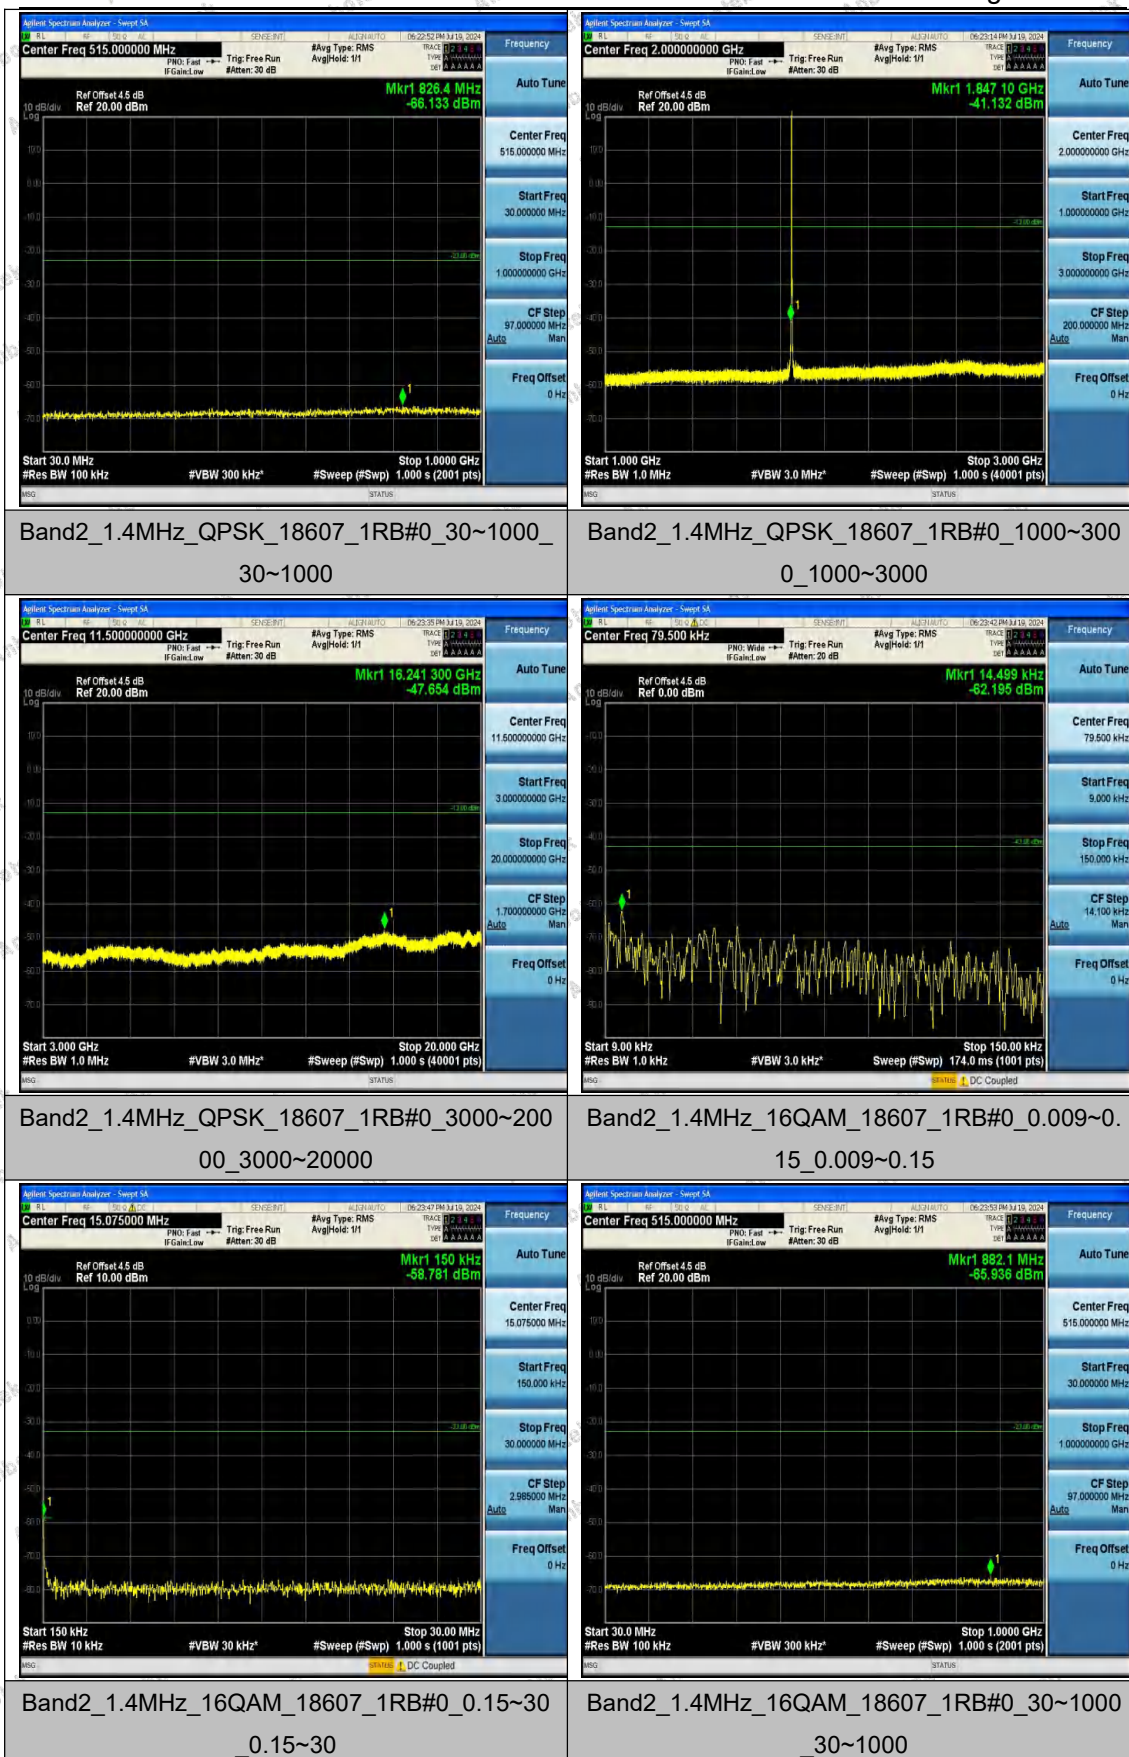

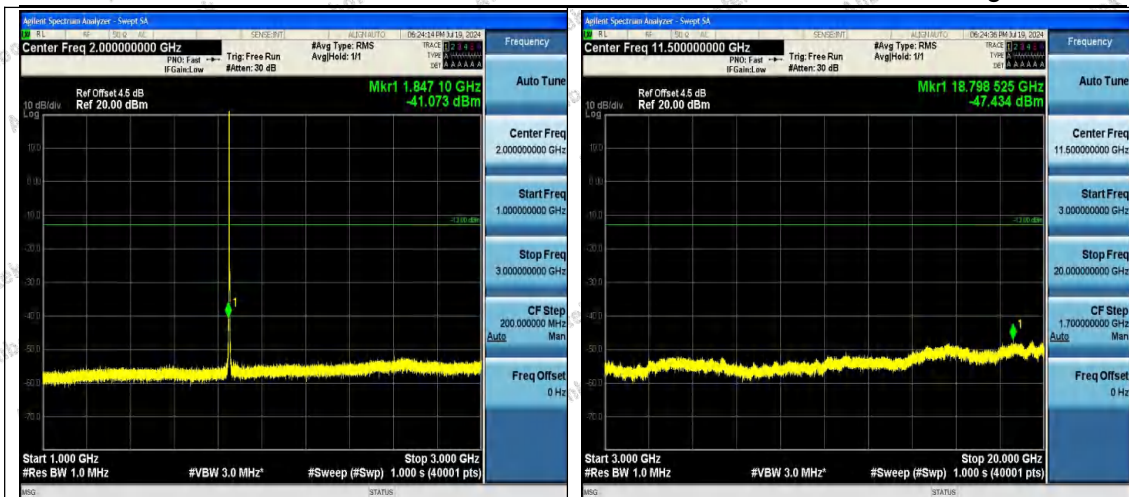


Band2_1.4MHz_16QAM_18607_1RB#0_1000~3
000_1000~3000

Band2_1.4MHz_16QAM_18607_1RB#0_3000~20
000_3000~20000

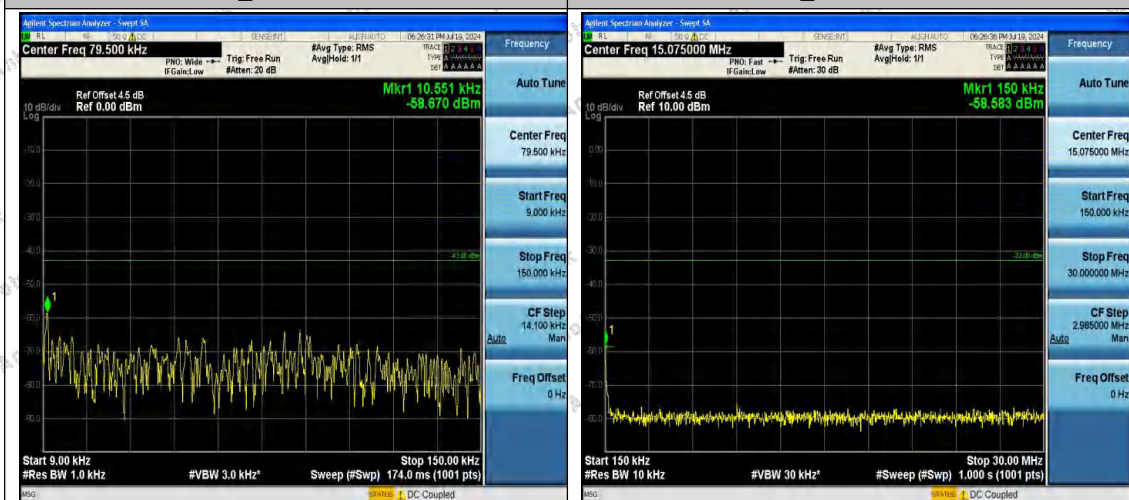

Band2_1.4MHz_QPSK_18900_1RB#0_0.009~0.1
5_0.009~0.15


Band2_1.4MHz_QPSK_18900_1RB#0_0.15~30_0
.15~30

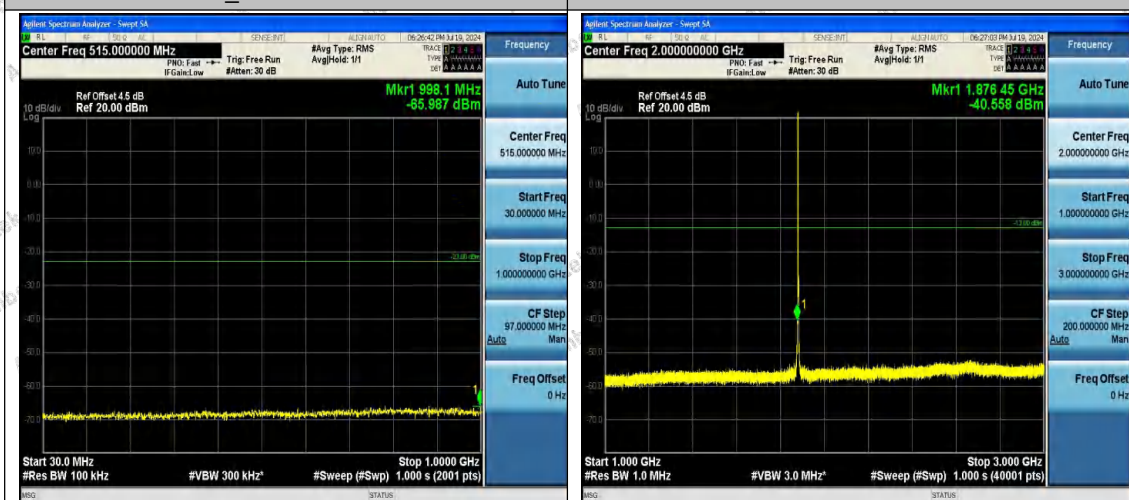


Band2_1.4MHz_QPSK_18900_1RB#0_30~1000_
30~1000

Band2_1.4MHz_QPSK_18900_1RB#0_1000~300
0_1000~3000




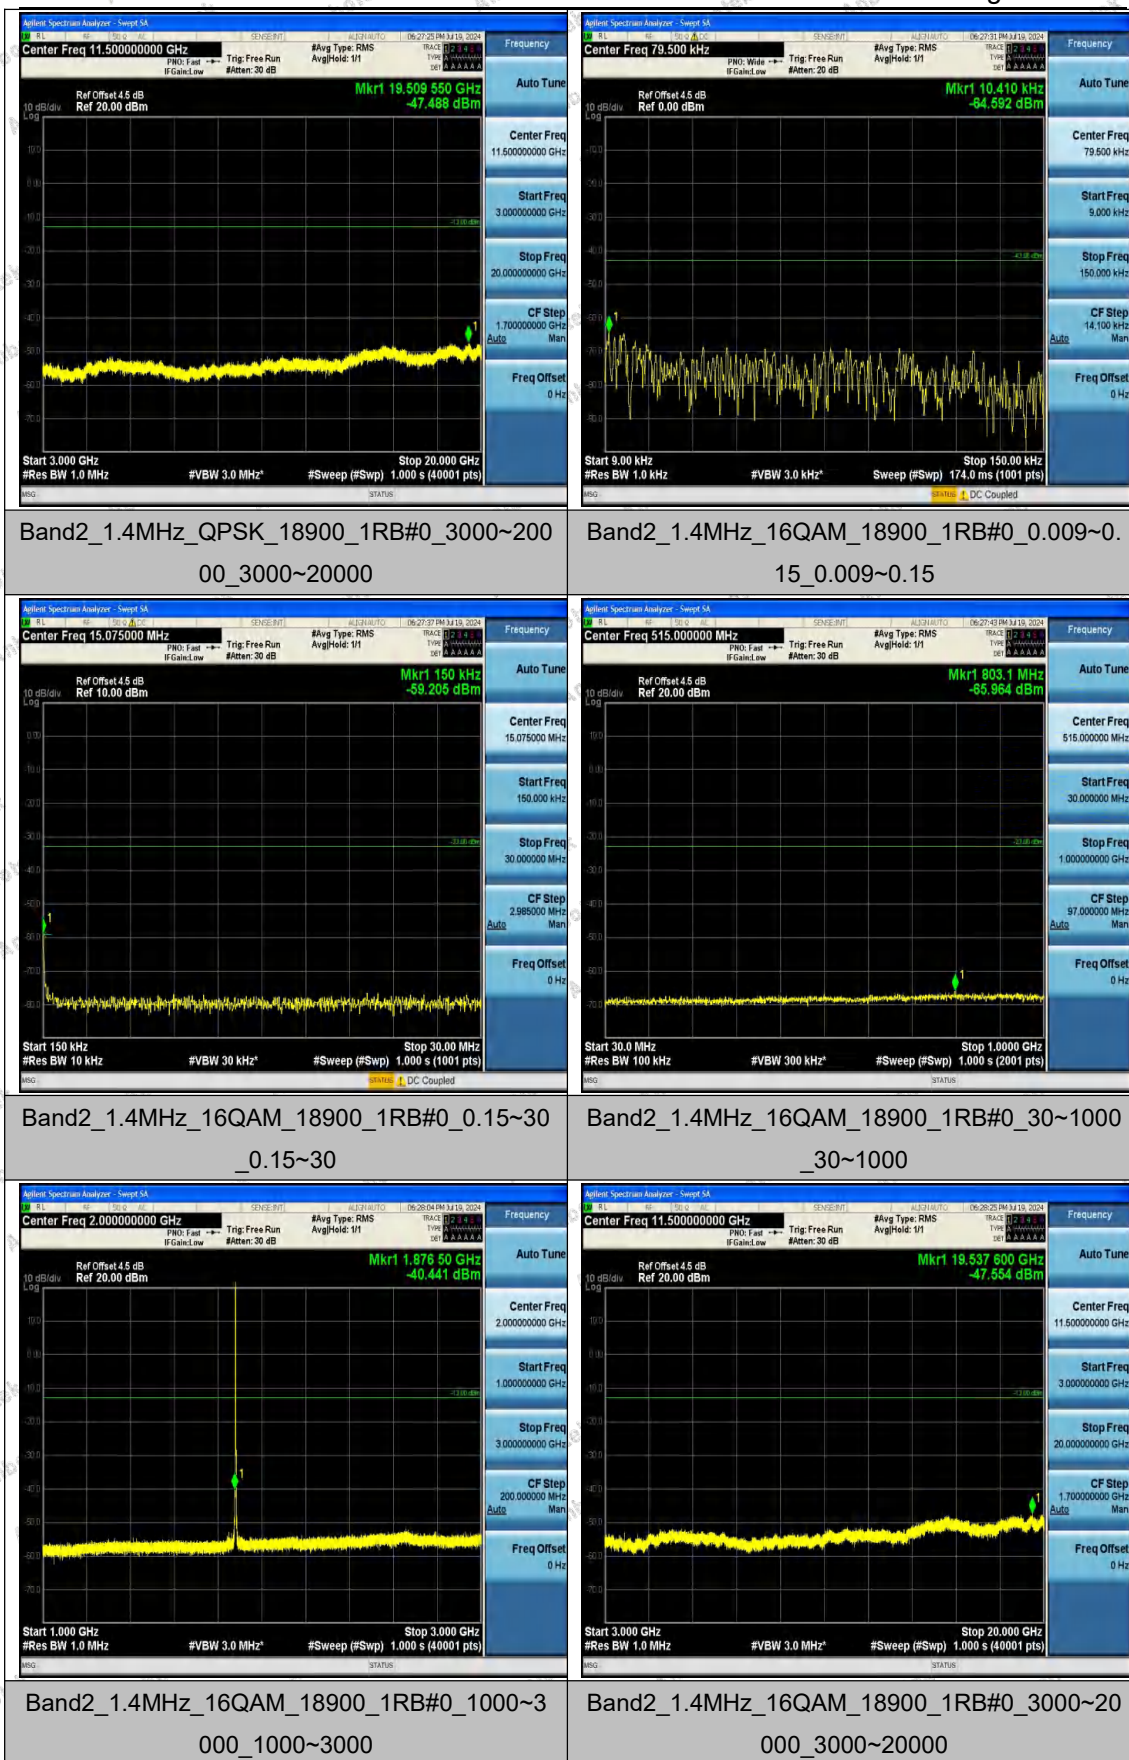

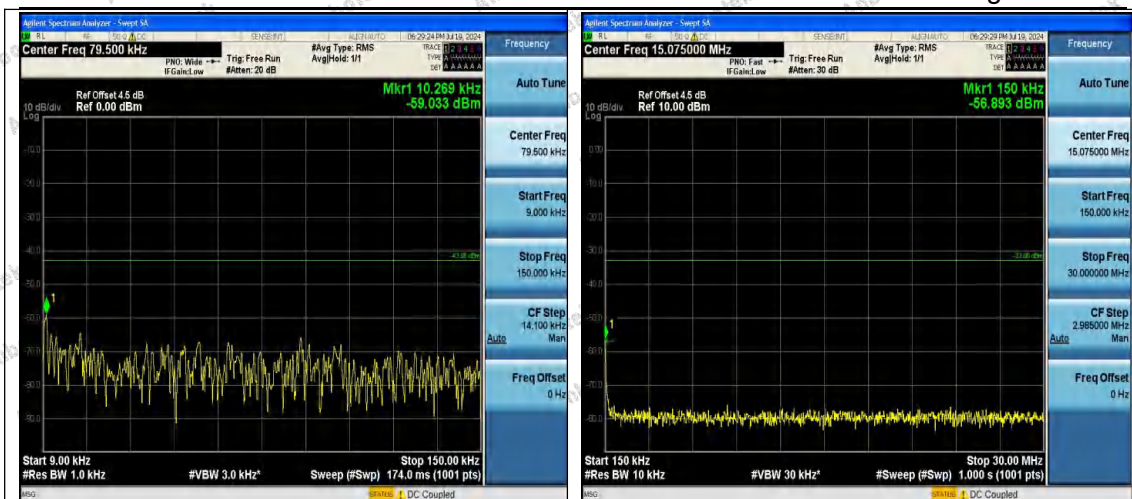


Band2_1.4MHz_QPSK_19193_1RB#0_0.009~0.1
5_0.009~0.15

Band2_1.4MHz_QPSK_19193_1RB#0_0.15~30_0
.15~30

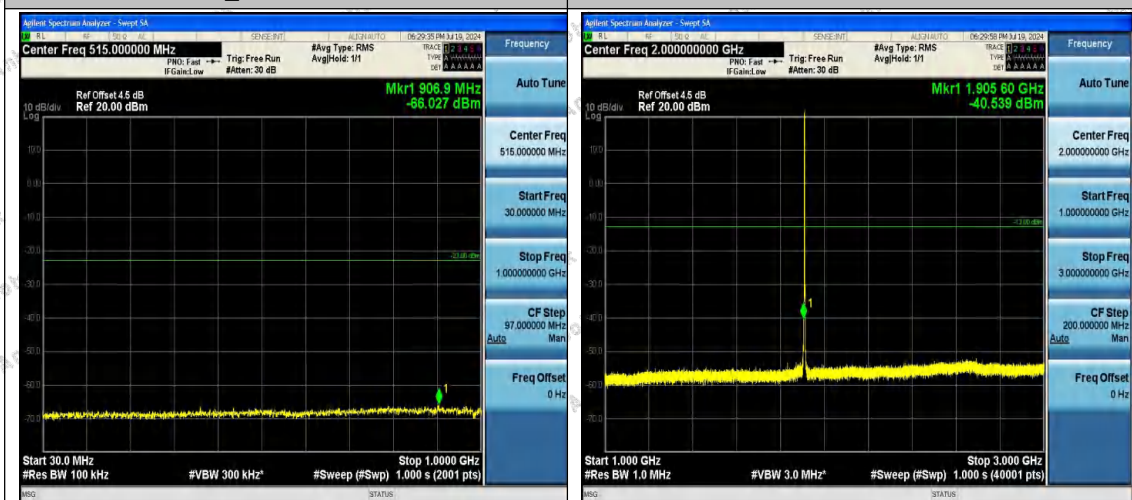

Band2_1.4MHz_QPSK_19193_1RB#0_30~1000_30~1000


Band2_1.4MHz_QPSK_19193_1RB#0_1000~3000_0_1000~3000

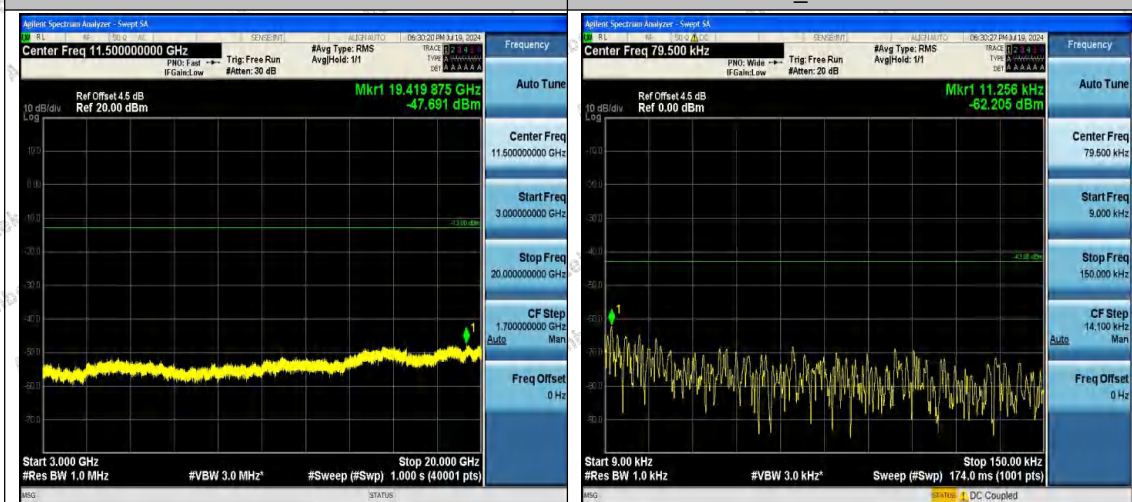

Band2_1.4MHz_QPSK_19193_1RB#0_3000~20000_00_3000~20000

Band2_1.4MHz_16QAM_19193_1RB#0_0.009~0.15_0.009~0.15



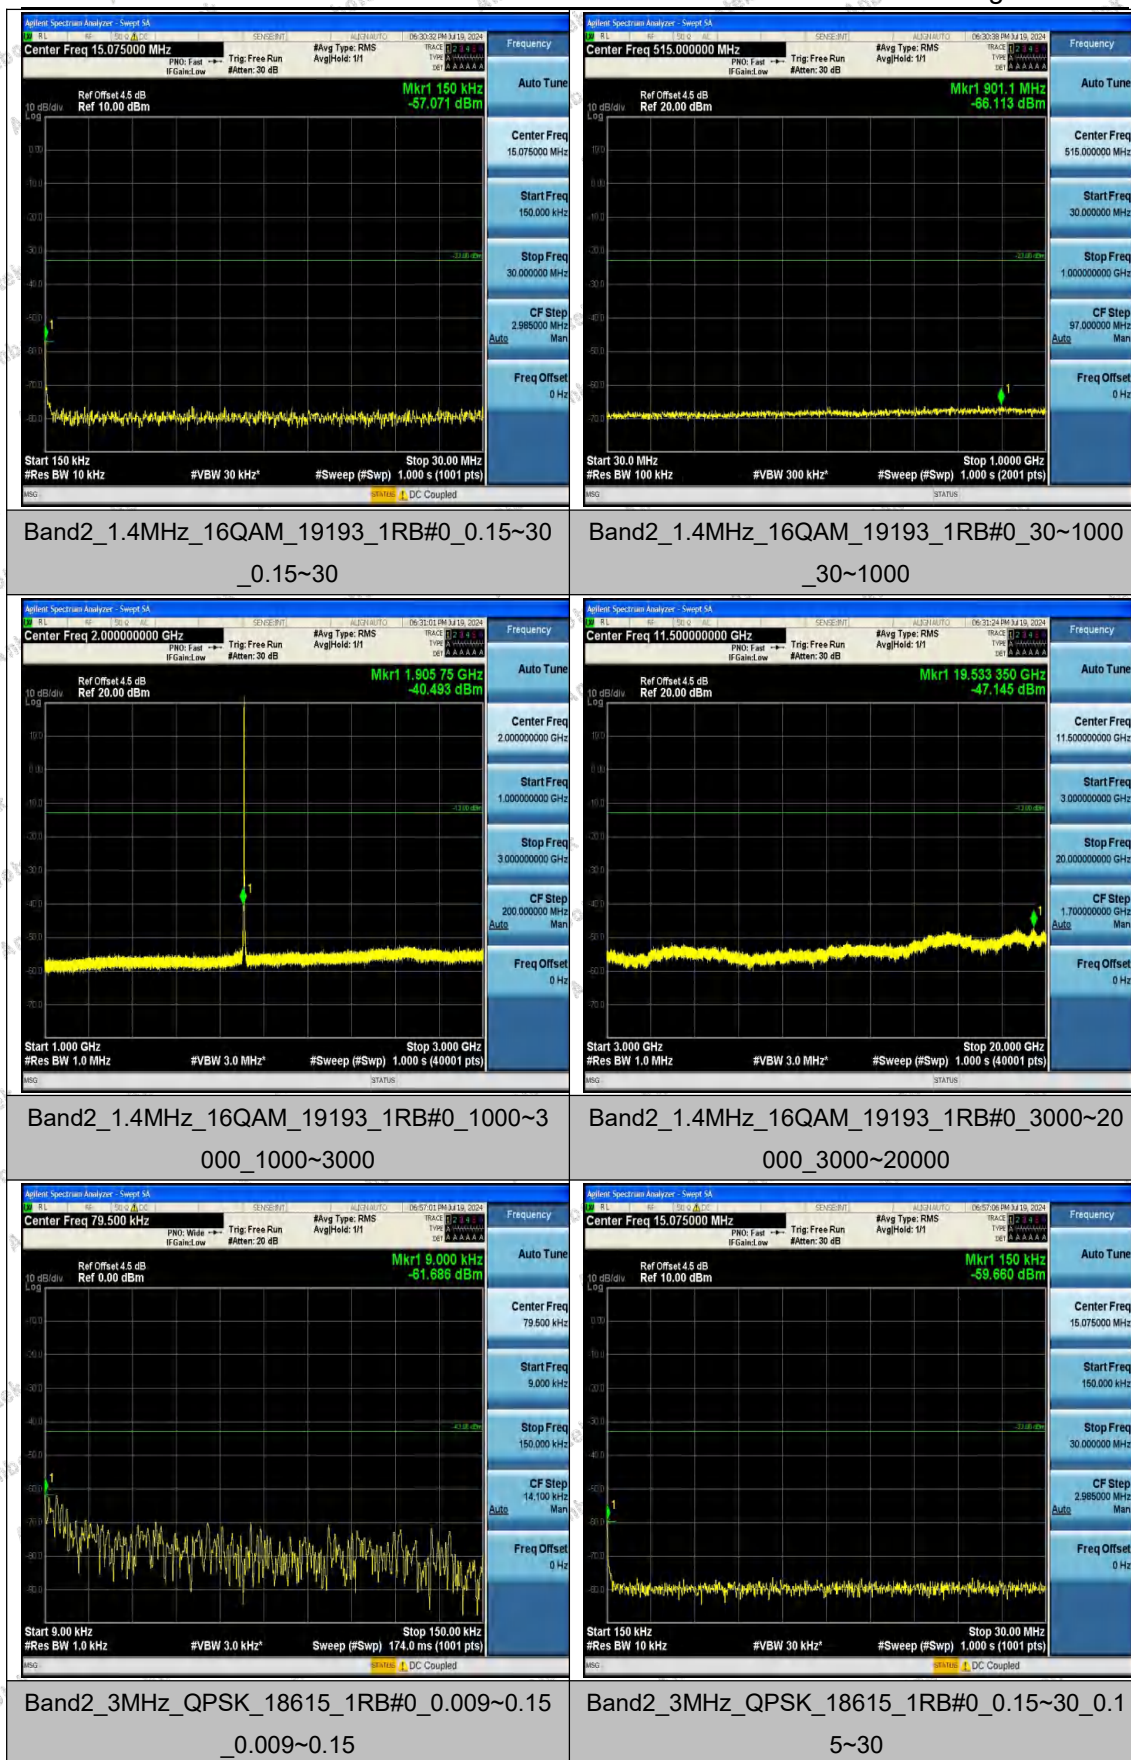

Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Email: service@anbotech.com





Hotline
400-003-0500

www.anbotech.com



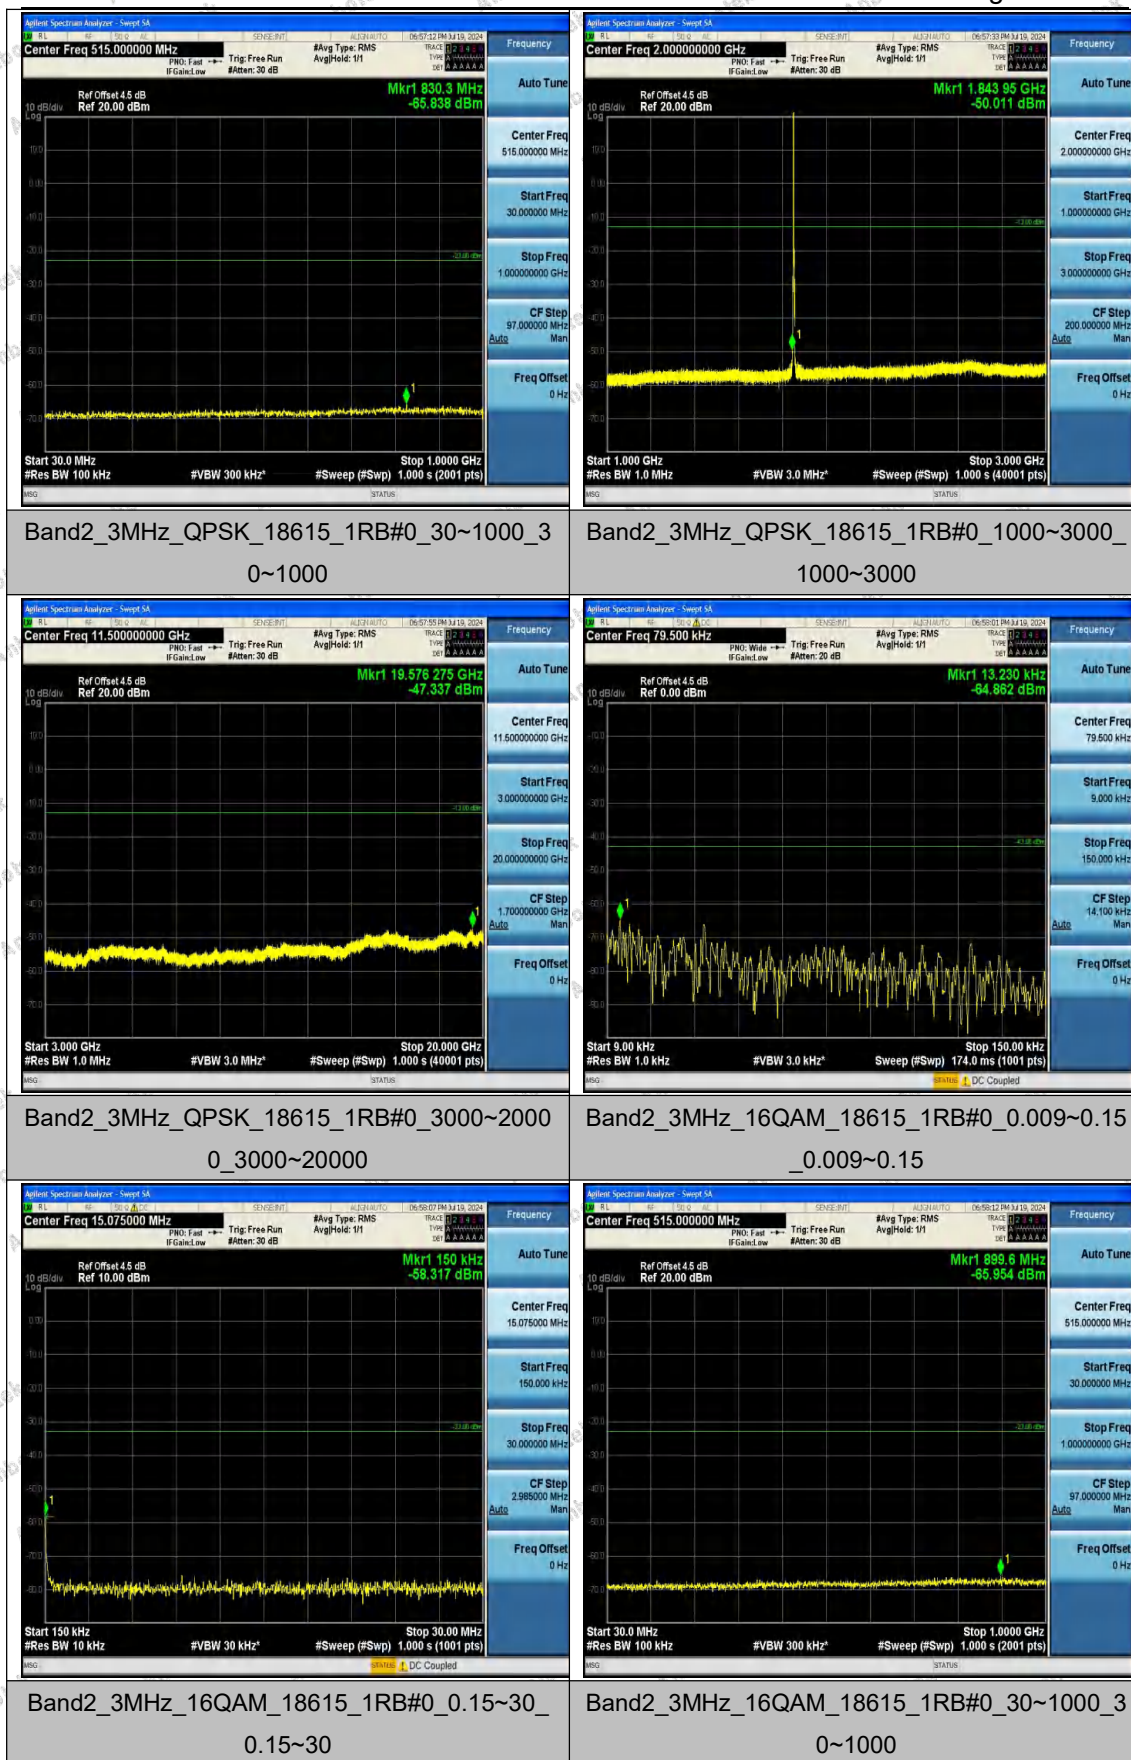

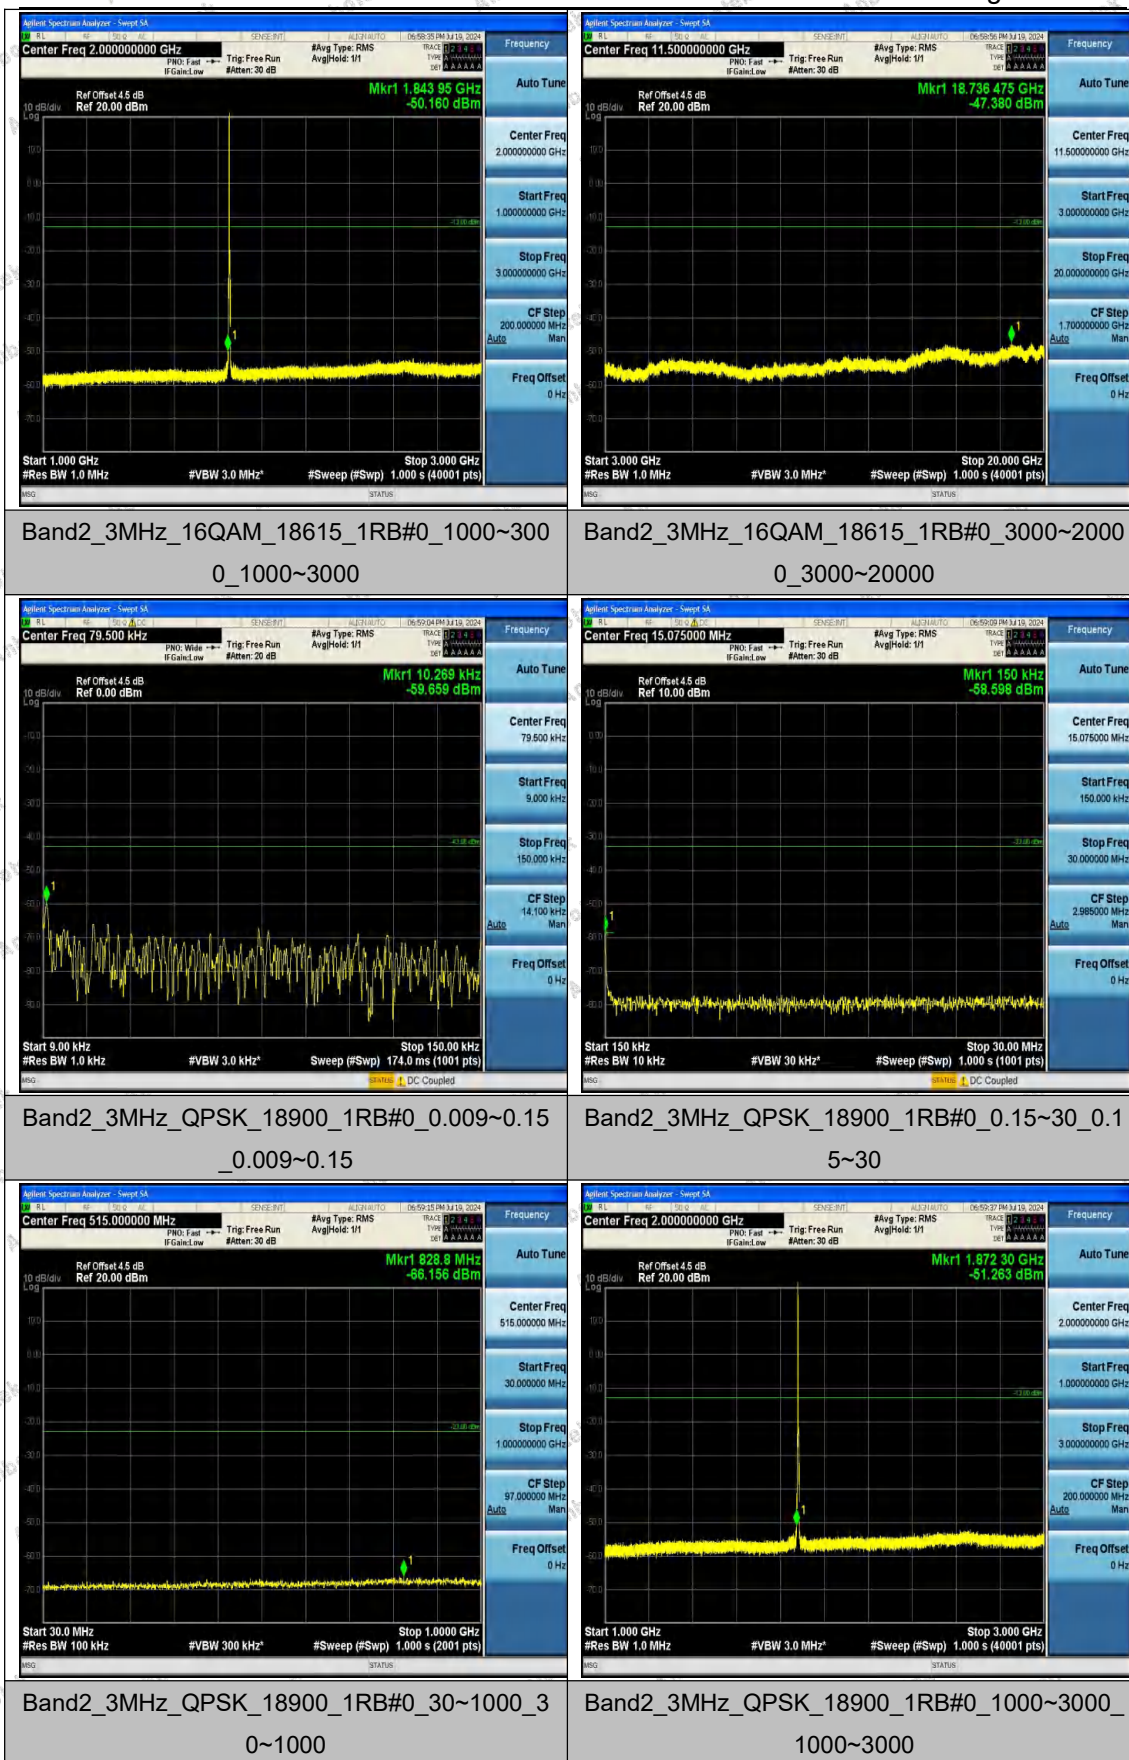

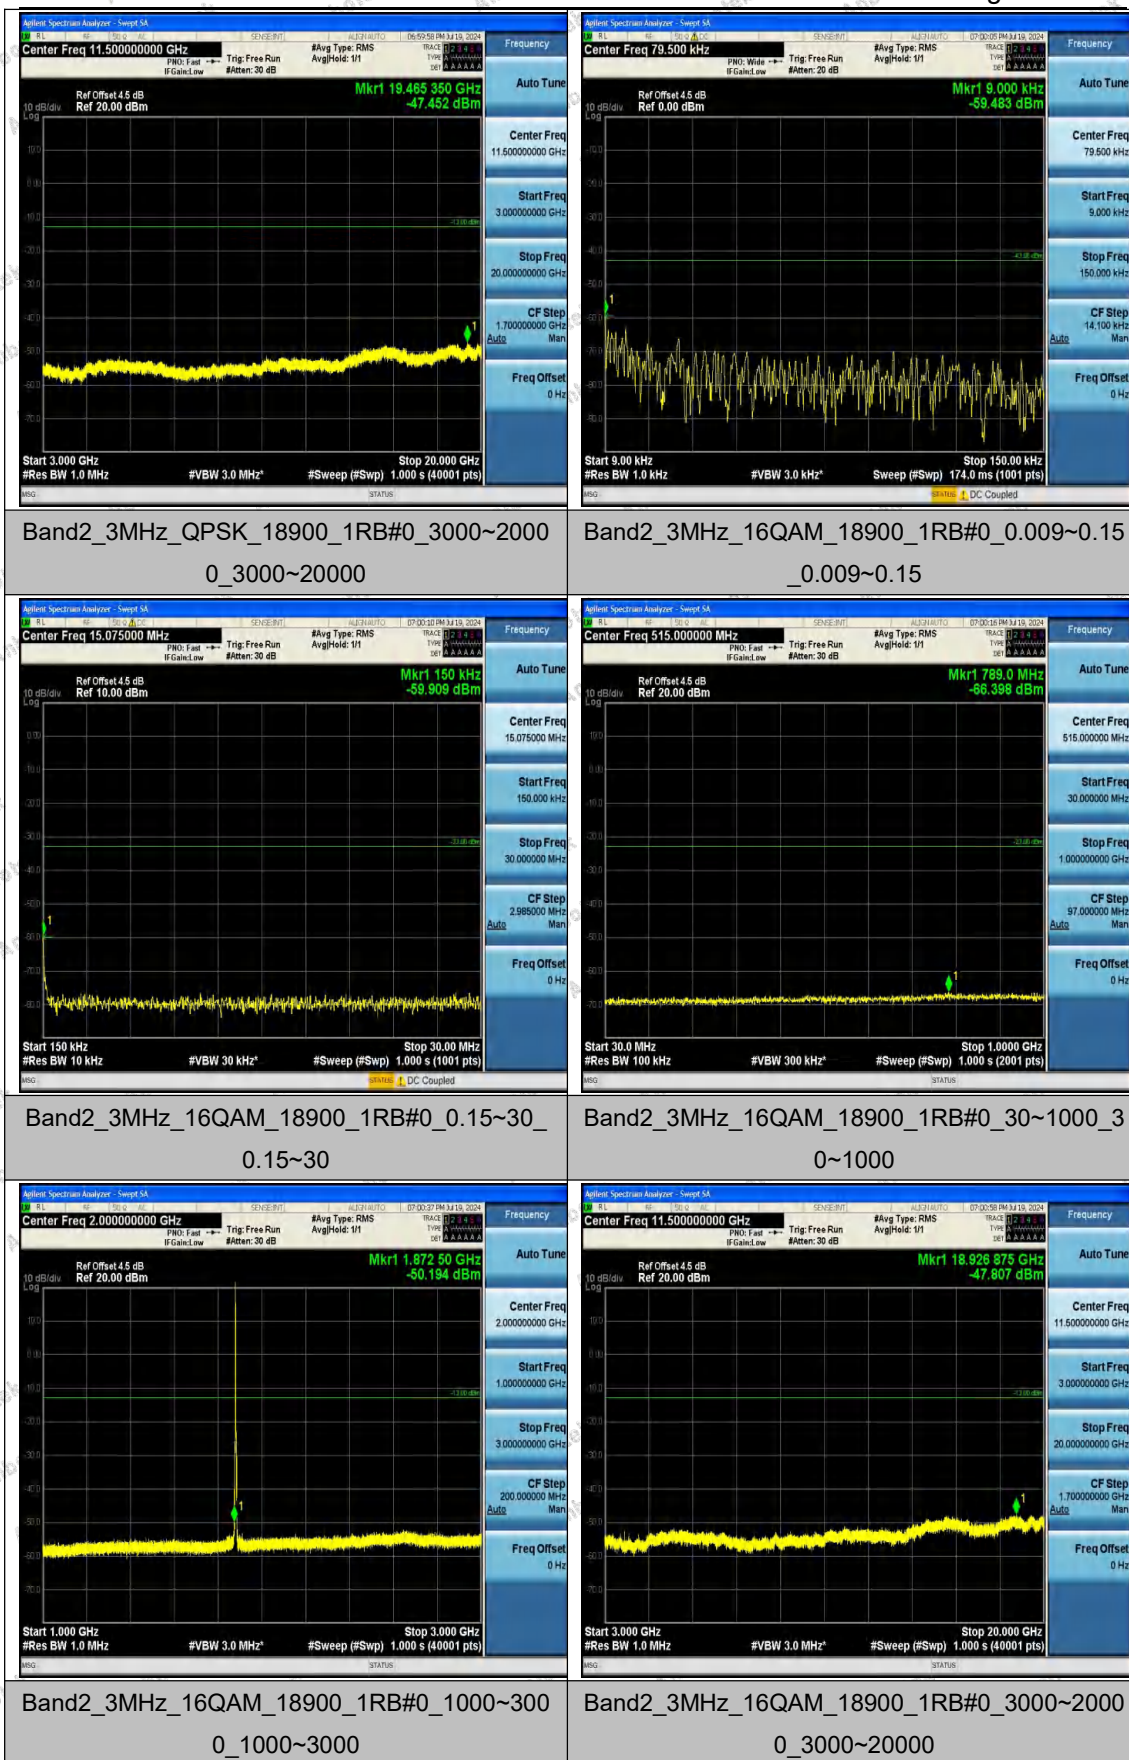

Shenzhen Anbotek Compliance Laboratory Limited




Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline
 400-003-0500


www.anbotek.com

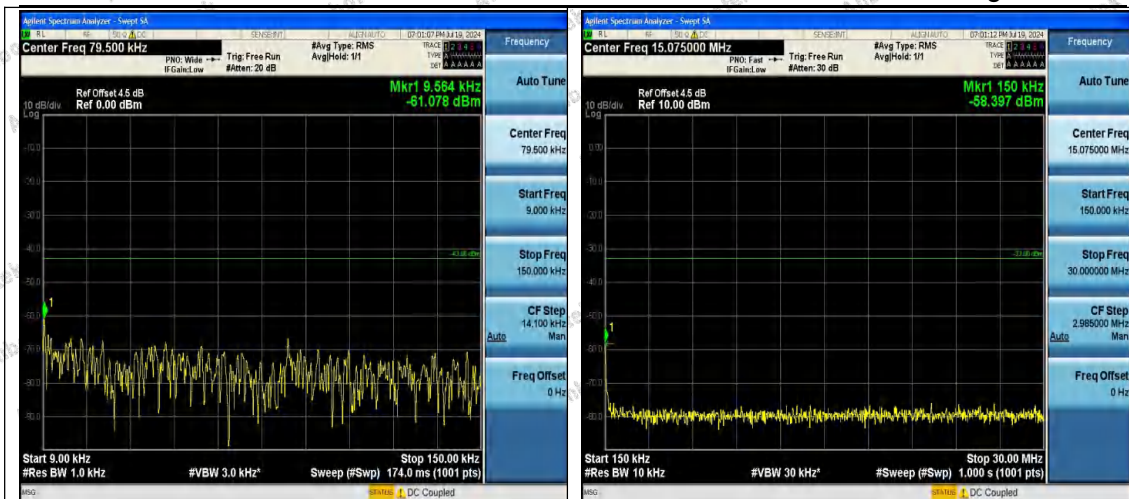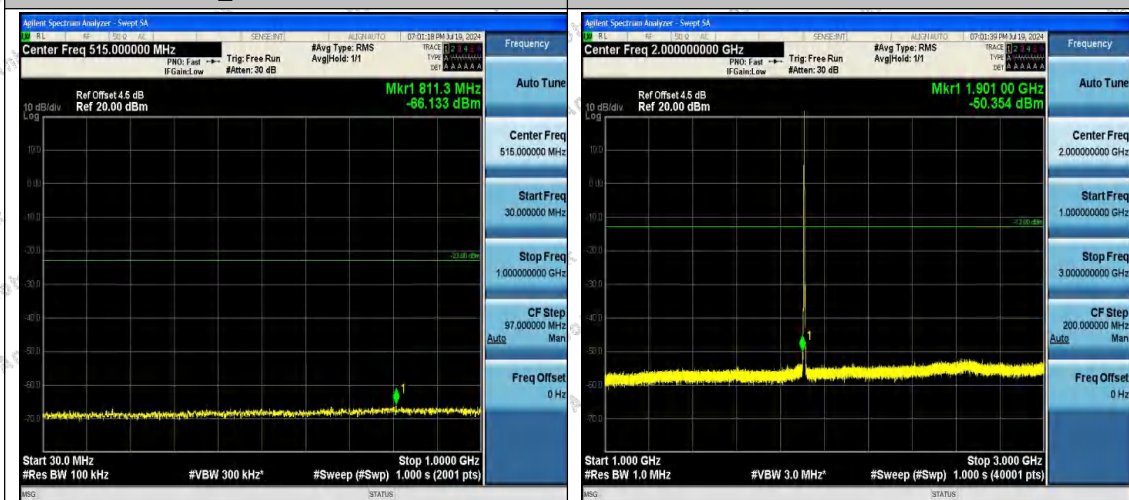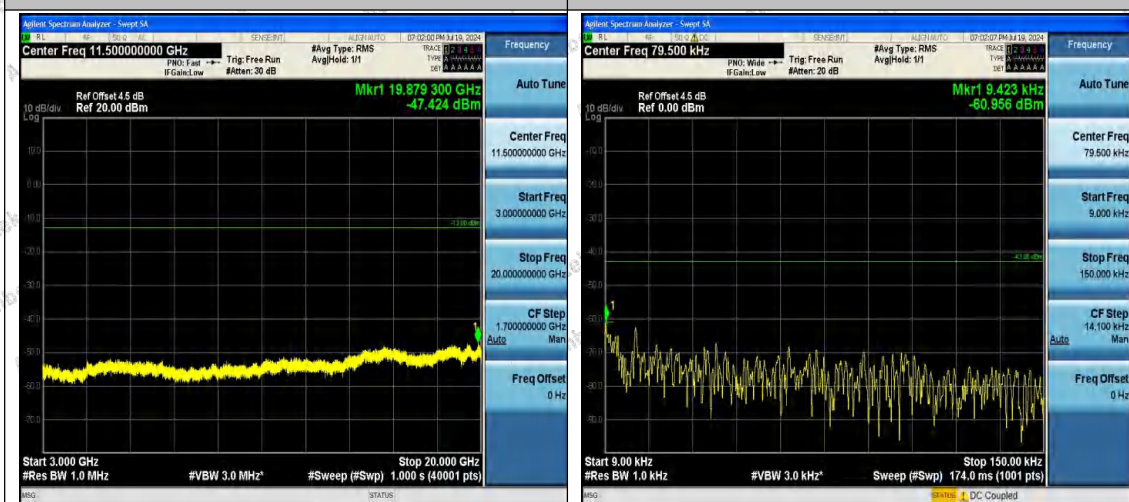

Band2_3MHz_QPSK_19185_1RB#0_0.009~0.15
_0.009~0.15Band2_3MHz_QPSK_19185_1RB#0_0.15~30_0.1
5~30Band2_3MHz_QPSK_19185_1RB#0_30~1000_3
0~1000Band2_3MHz_QPSK_19185_1RB#0_1000~3000_
1000~3000Band2_3MHz_QPSK_19185_1RB#0_3000~2000
0_3000~20000Band2_3MHz_16QAM_19185_1RB#0_0.009~0.15
_0.009~0.15

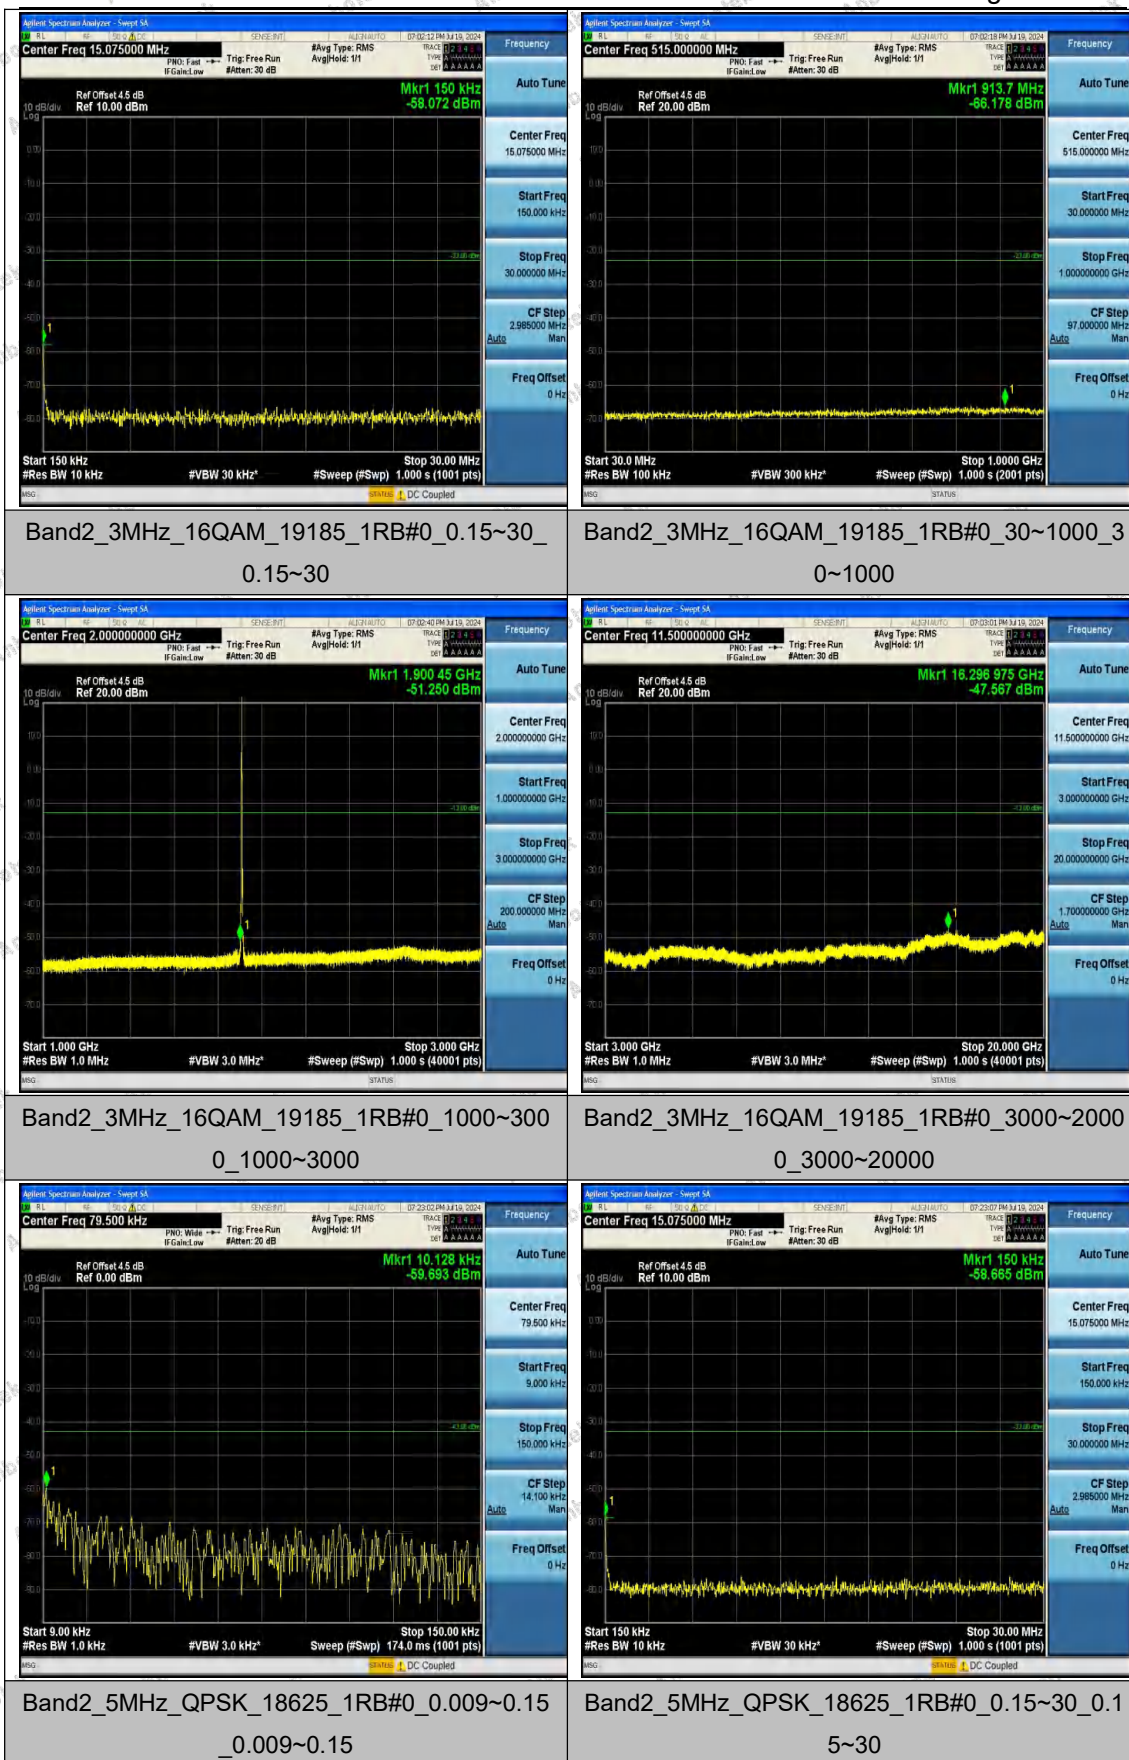


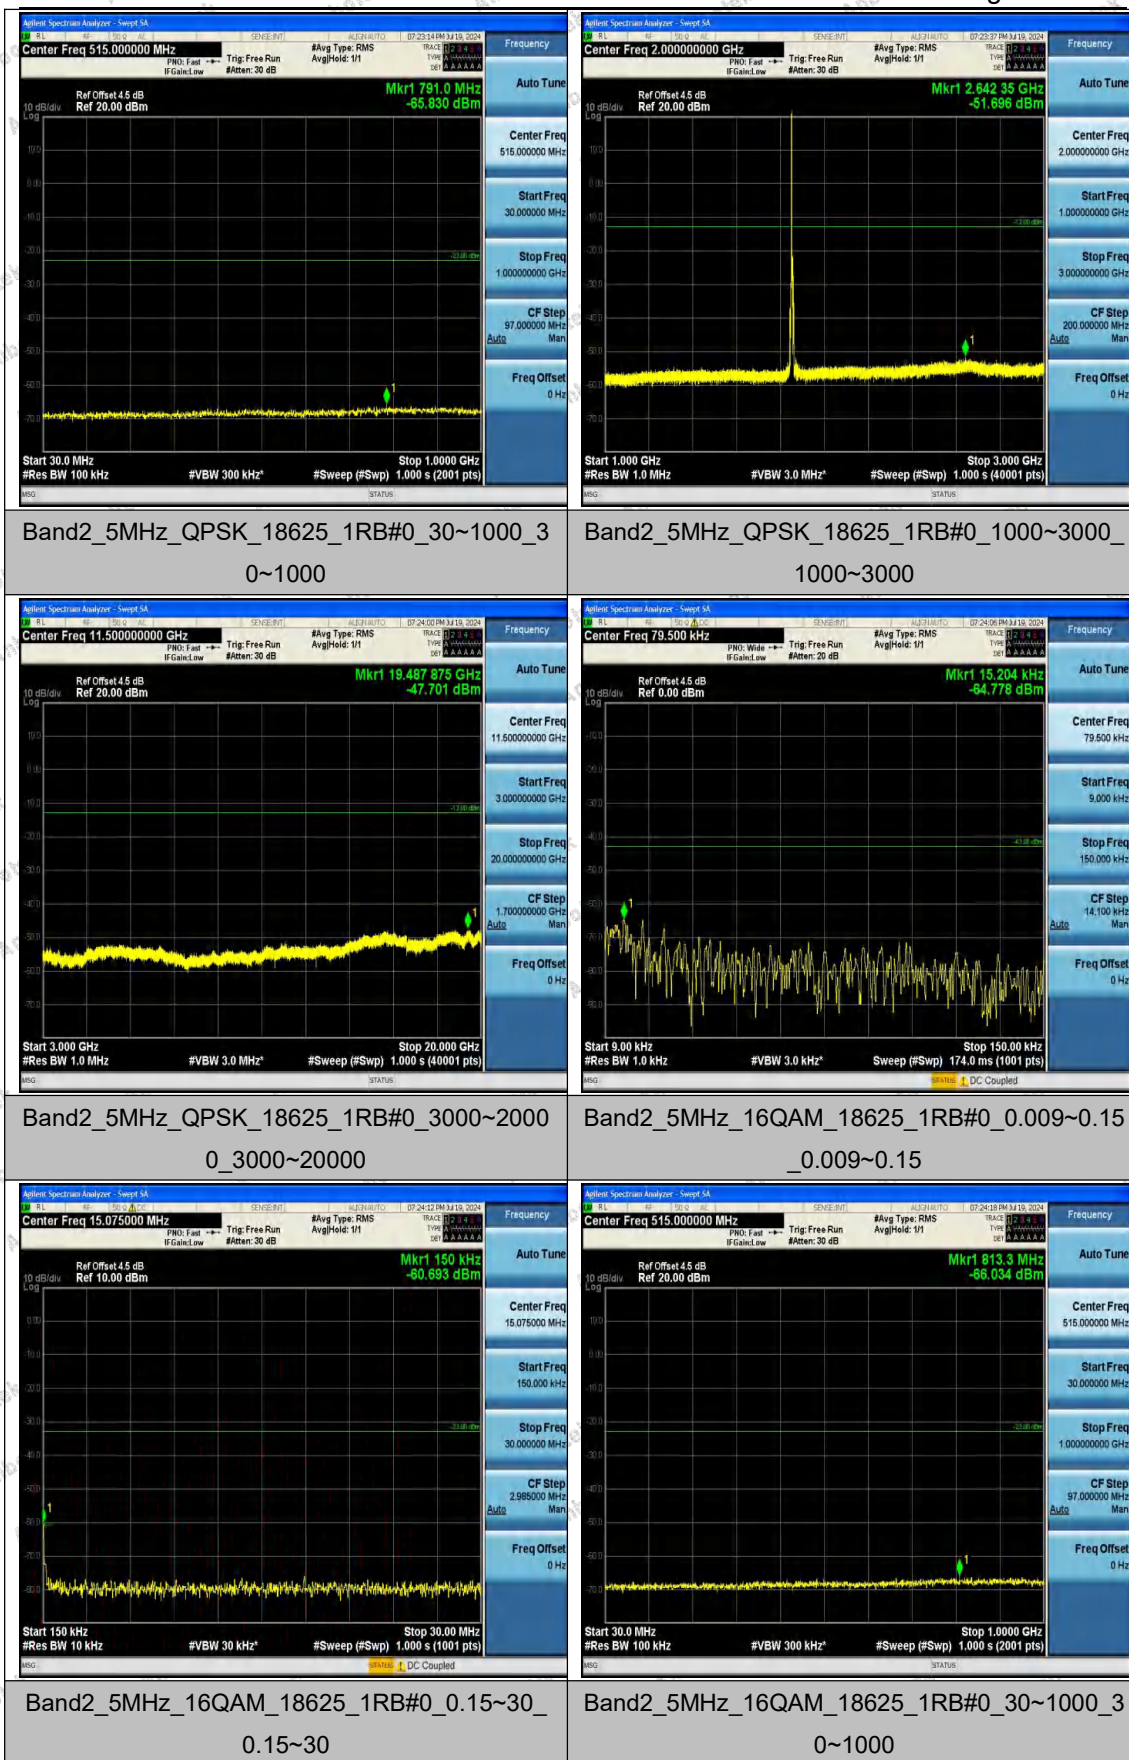

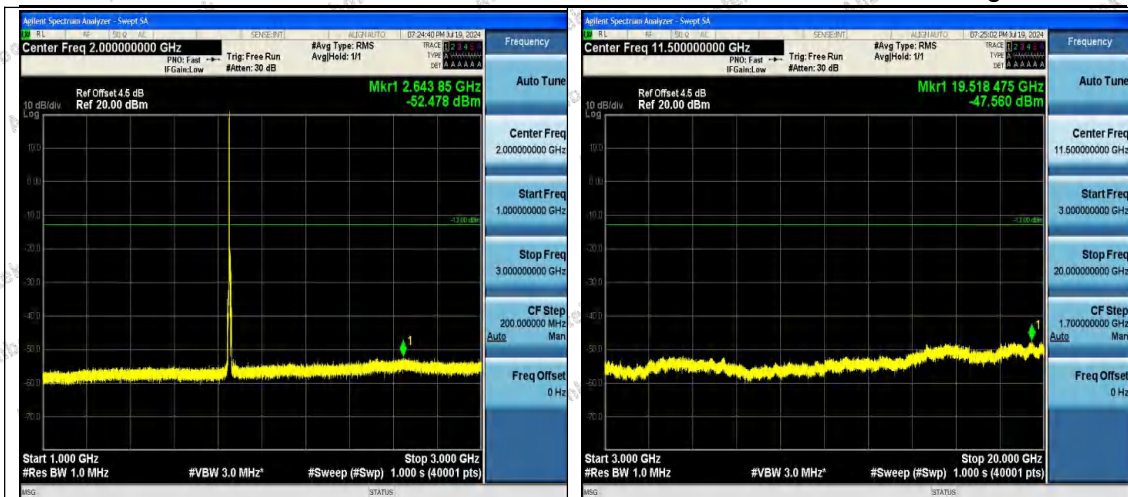


Band2_5MHz_16QAM_18625_1RB#0_1000~300
0_1000~3000

Band2_5MHz_16QAM_18625_1RB#0_3000~2000
0_3000~20000

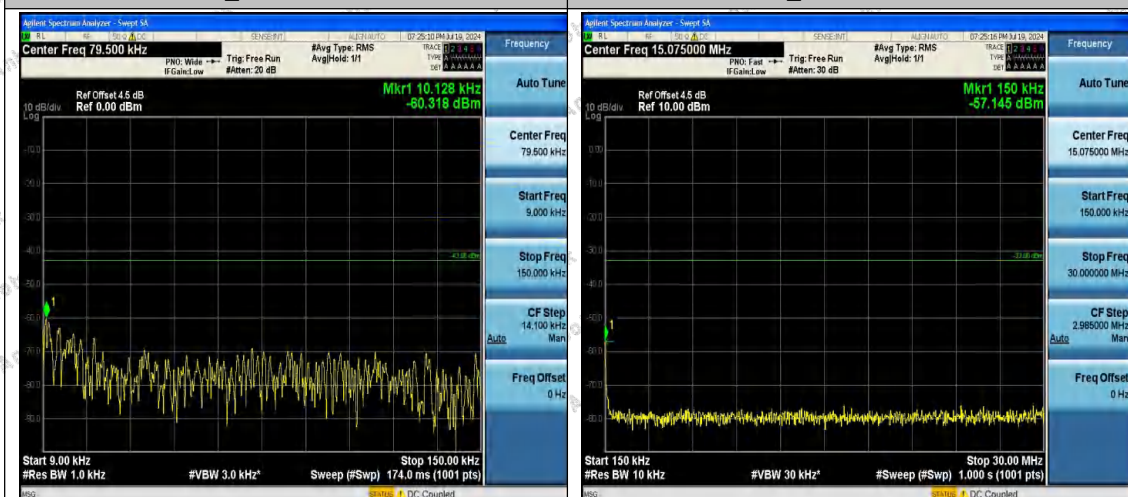

Band2_5MHz_QPSK_18900_1RB#0_0.009~0.15
_0.009~0.15


Band2_5MHz_QPSK_18900_1RB#0_0.15~30_0.1
5~30

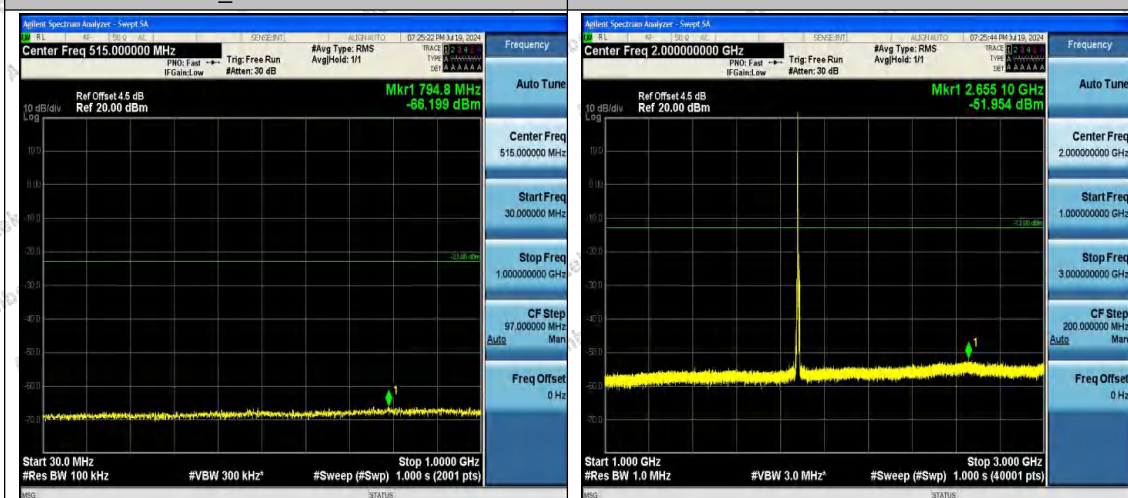

Band2_5MHz_QPSK_18900_1RB#0_30~1000_3
0~1000

Band2_5MHz_QPSK_18900_1RB#0_1000~3000_
1000~3000



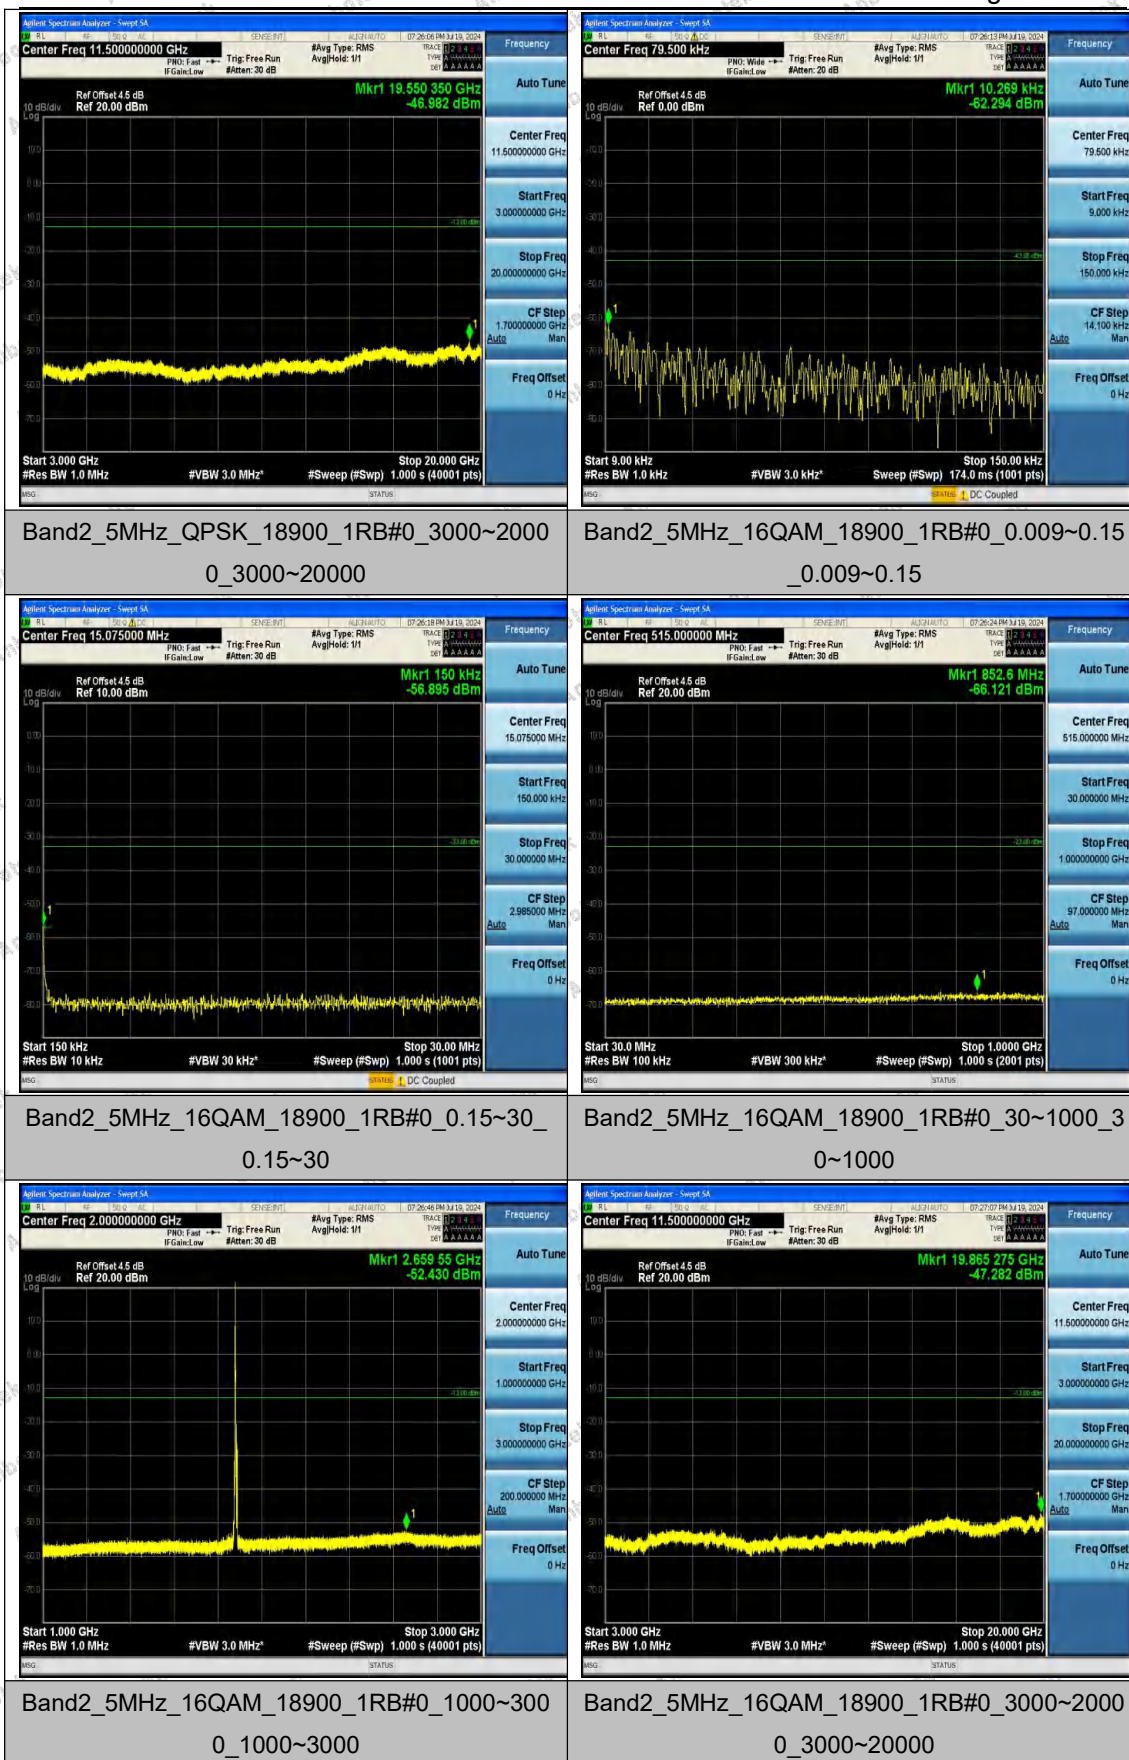

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com





Hotline

400-003-0500

www.anbotek.com



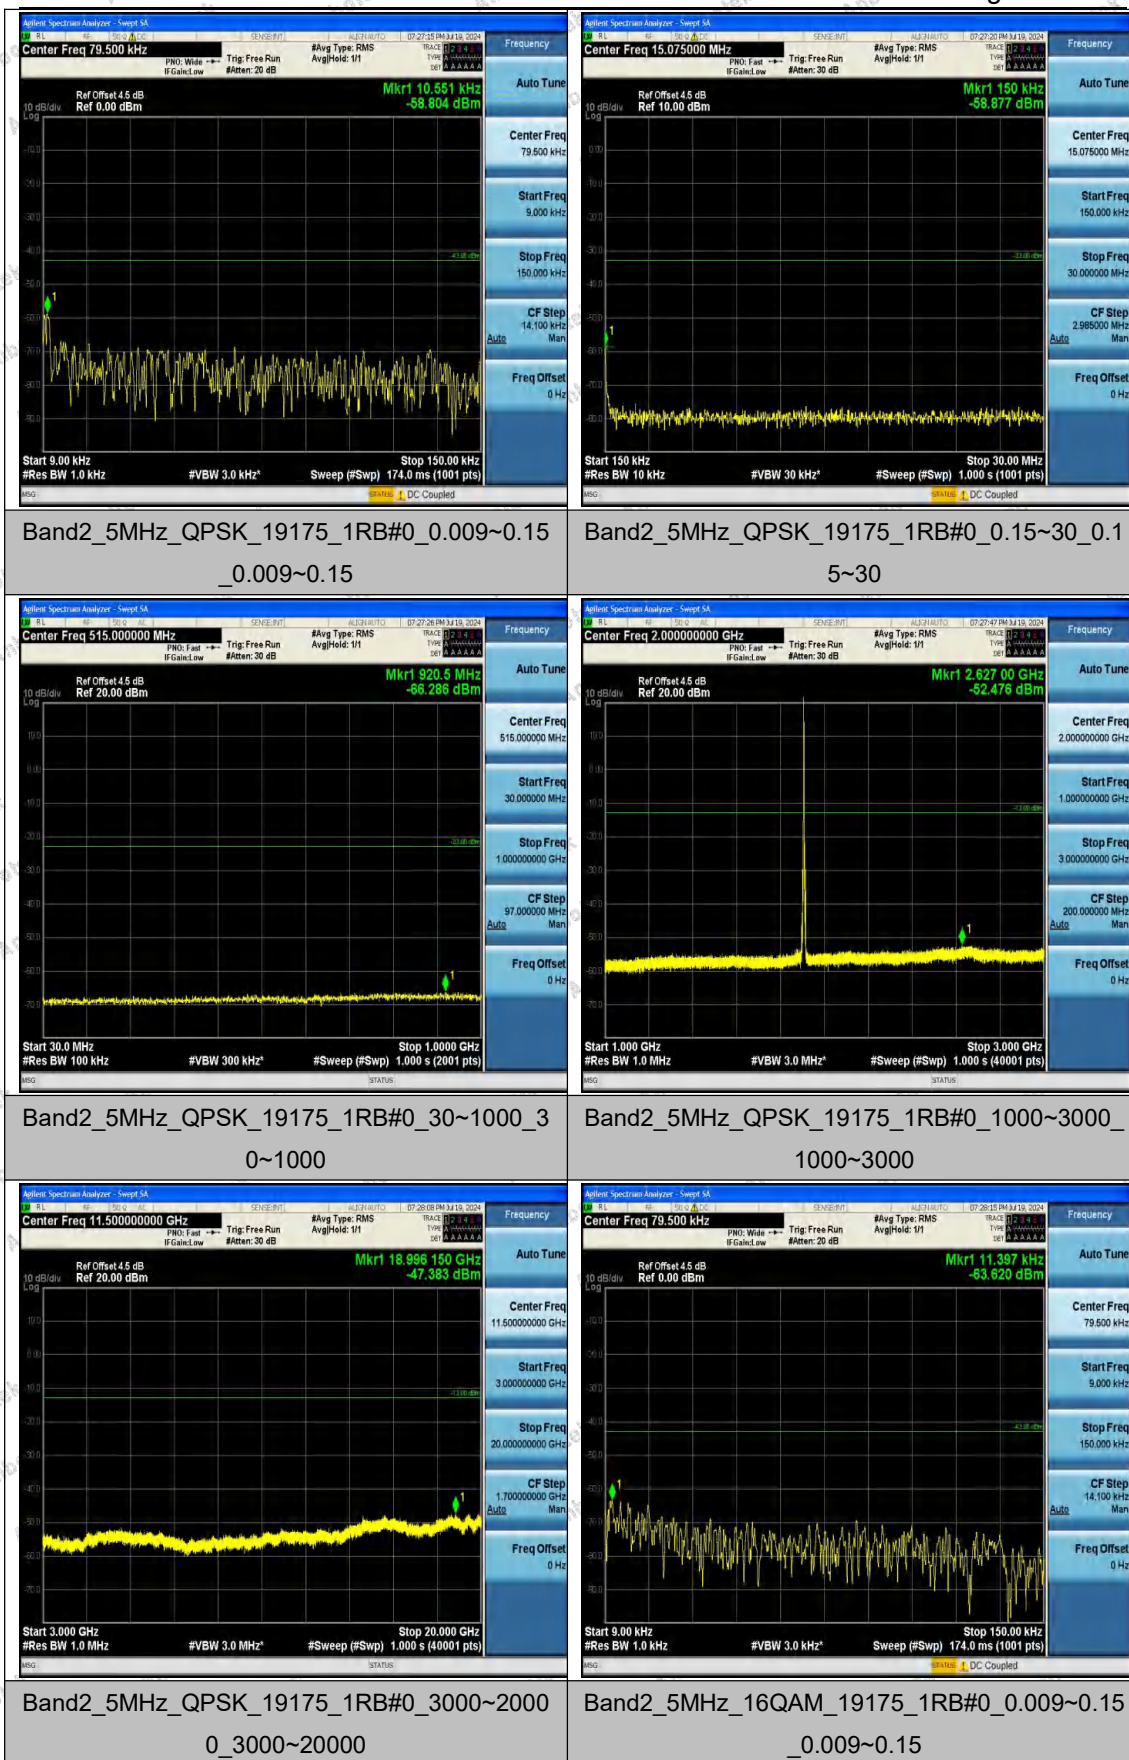

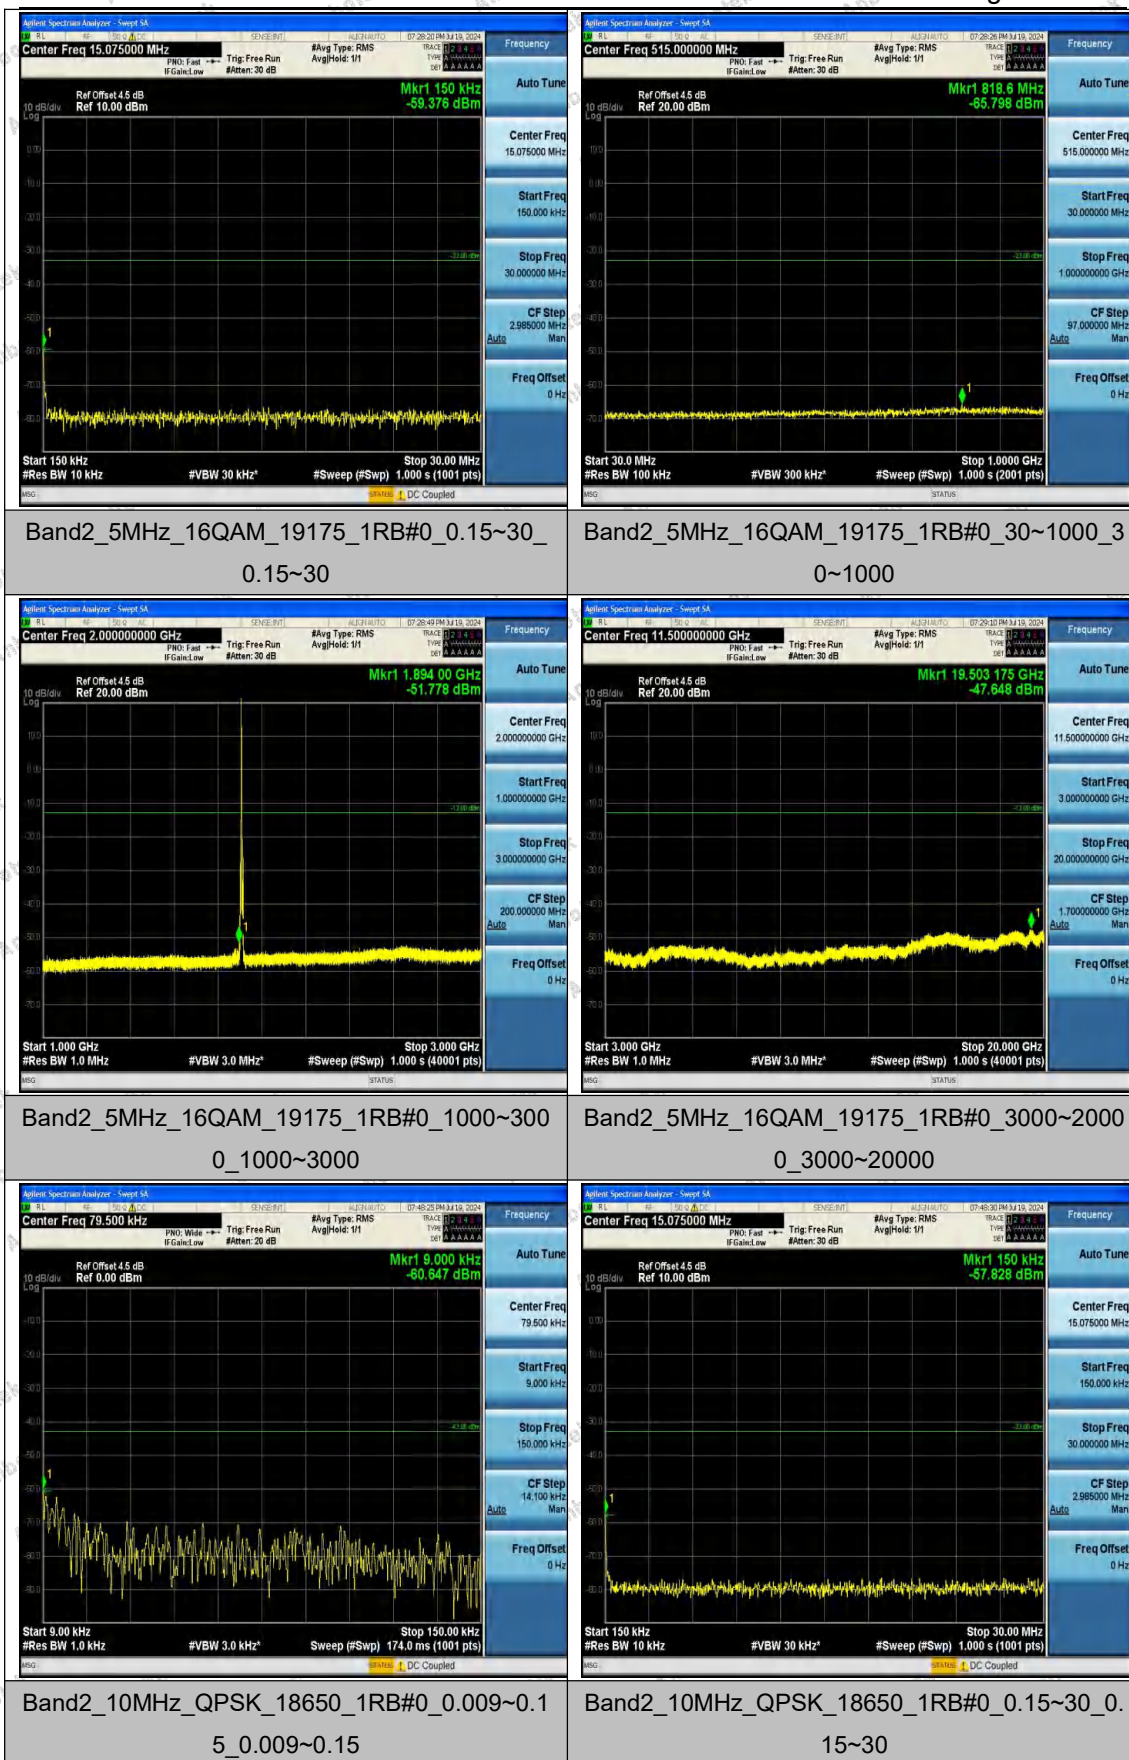

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
 400-003-0500

www.anbotek.com



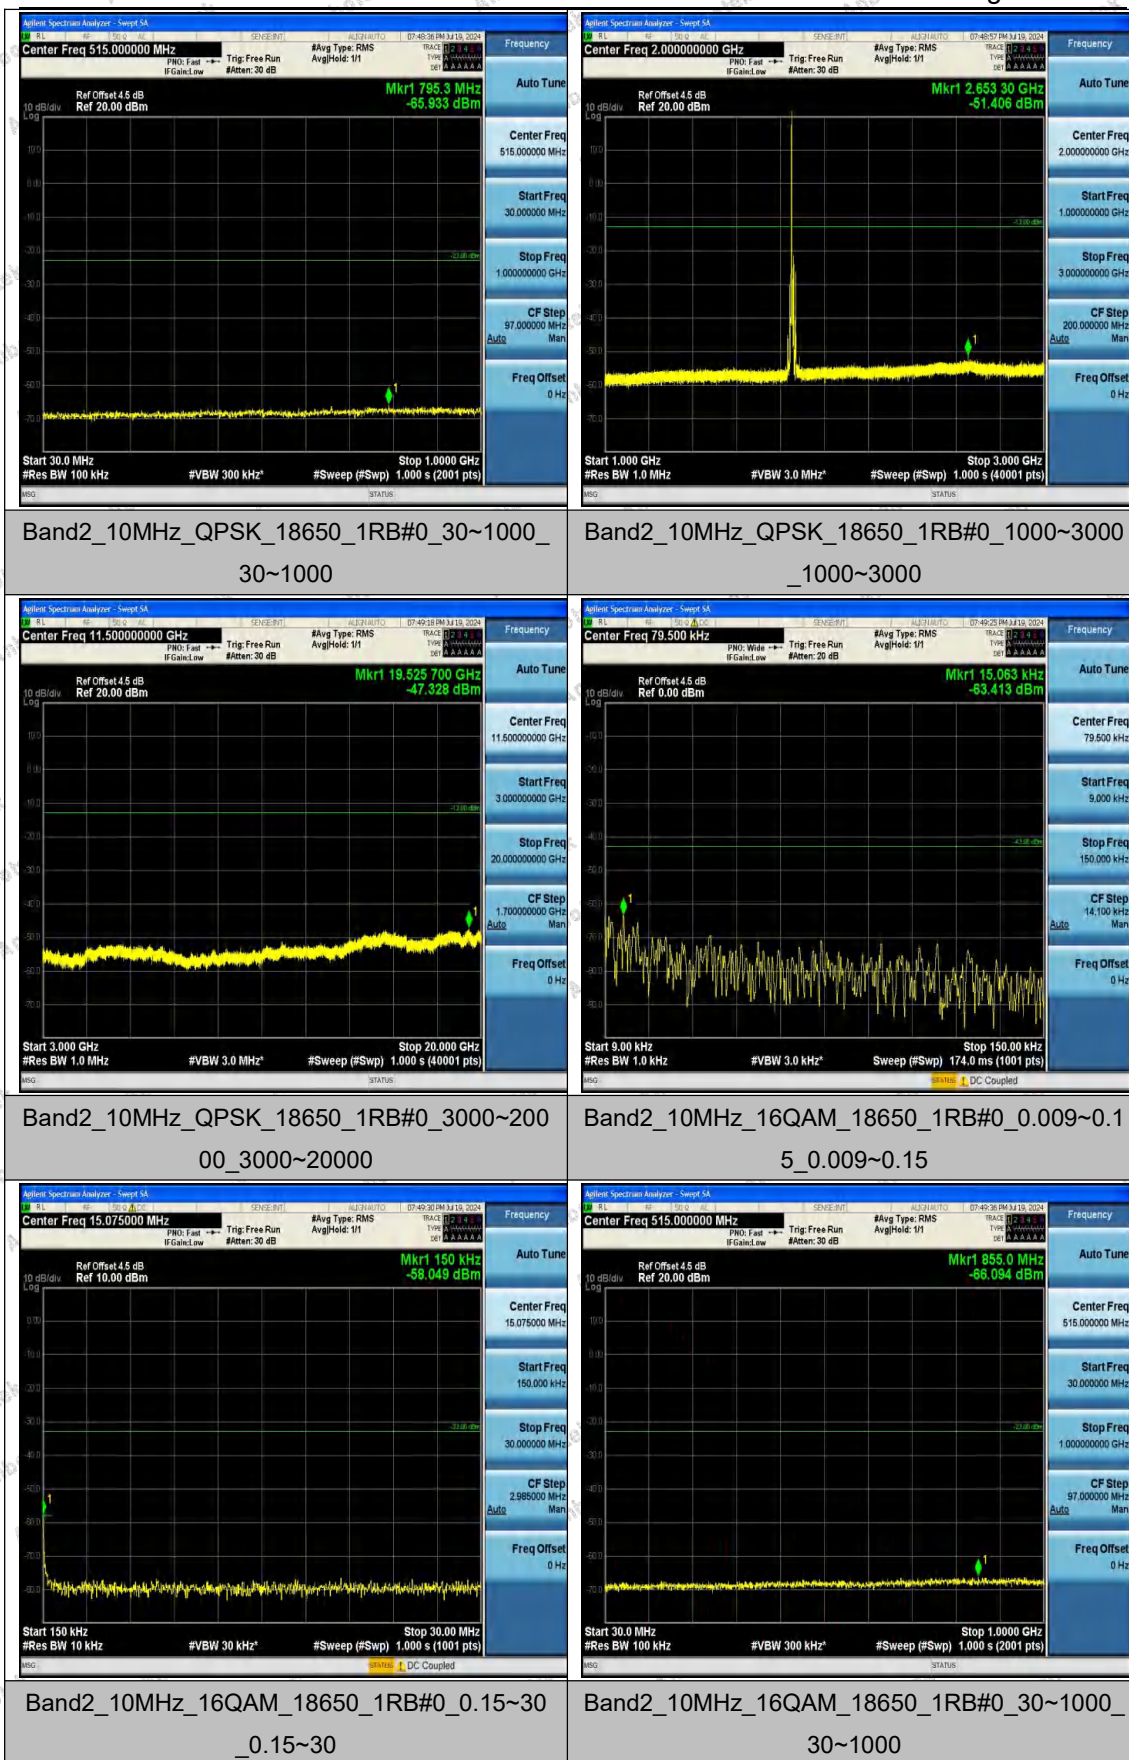

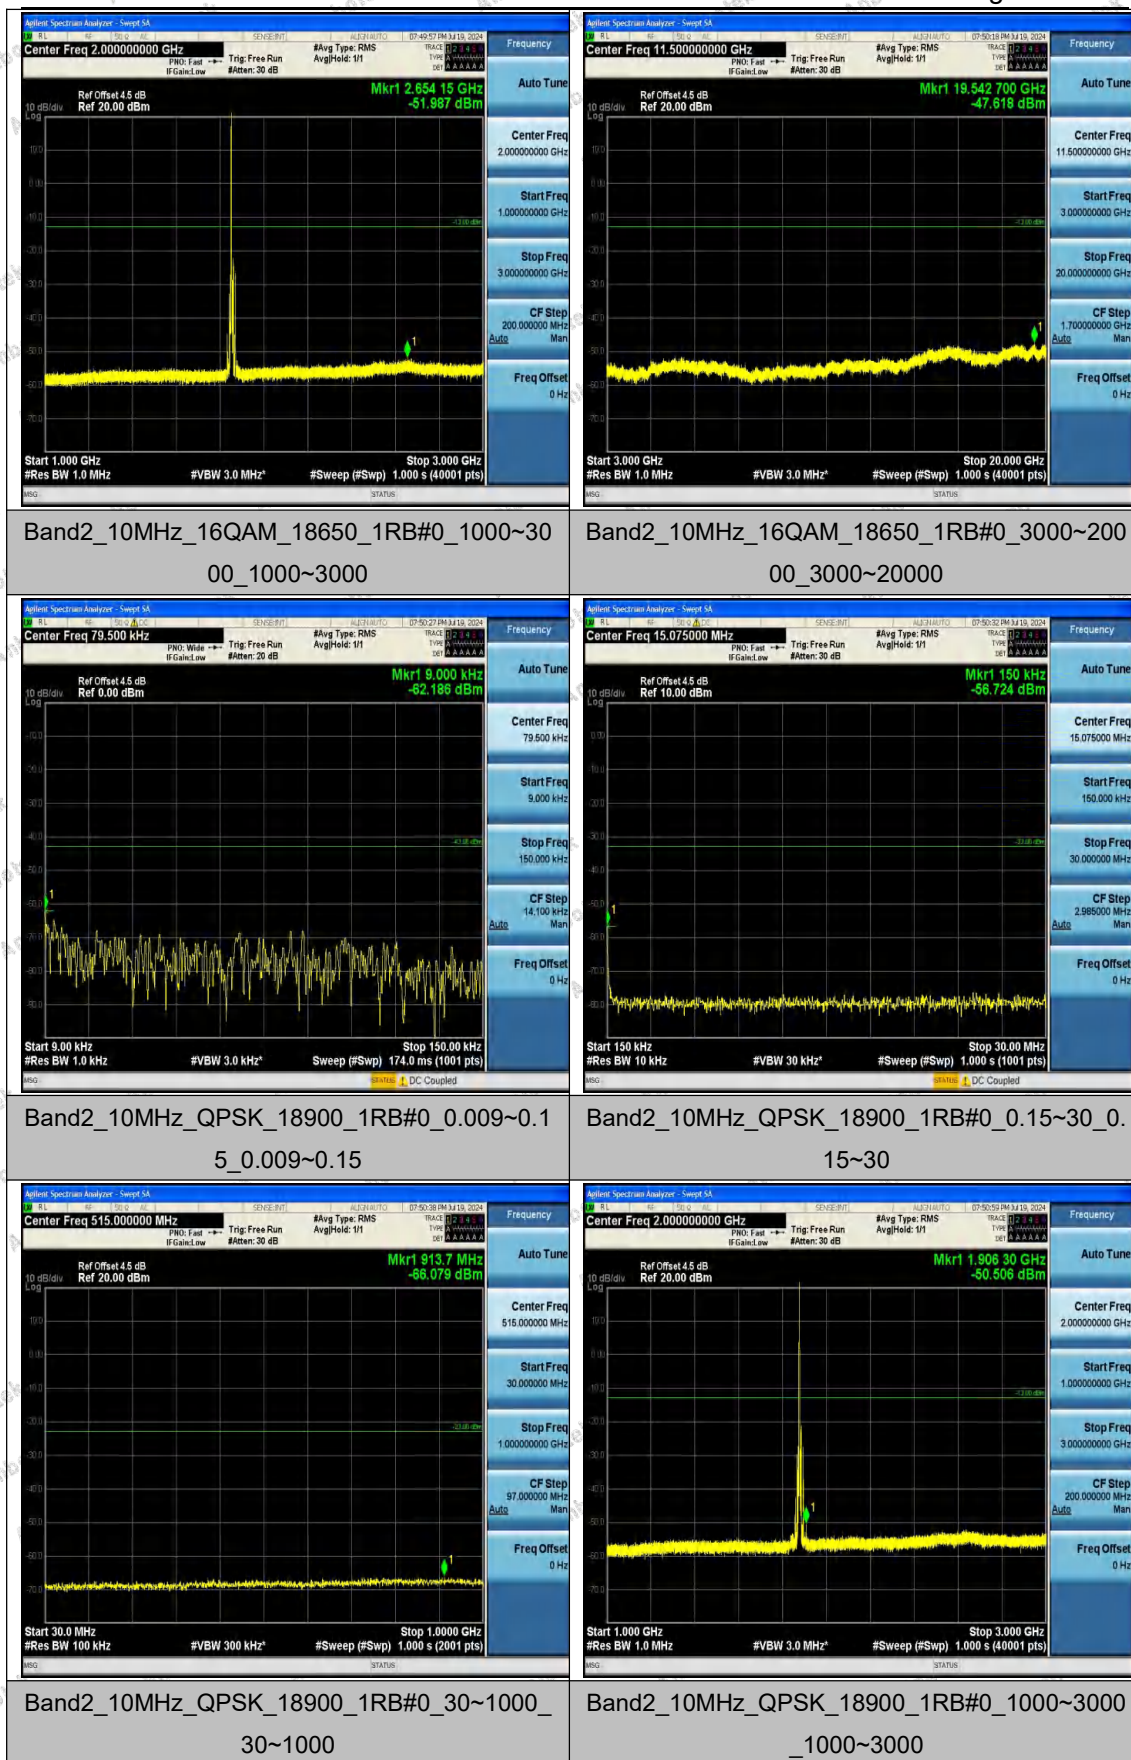

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
 400-003-0500


www.anbotek.com



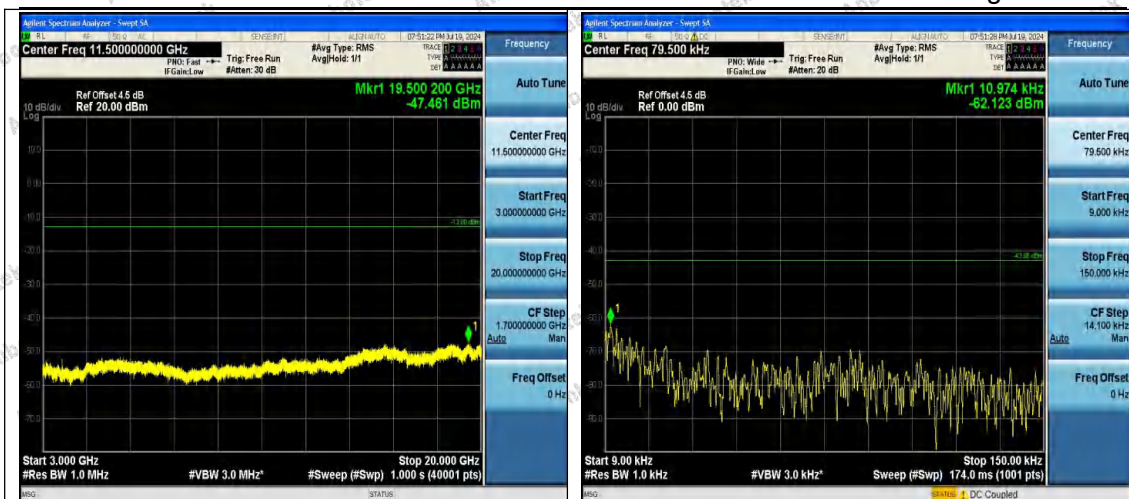


Band2_10MHz_QPSK_18900_1RB#0_3000~2000_3000~20000

Band2_10MHz_16QAM_18900_1RB#0_0.009~0.15_0.009~0.15

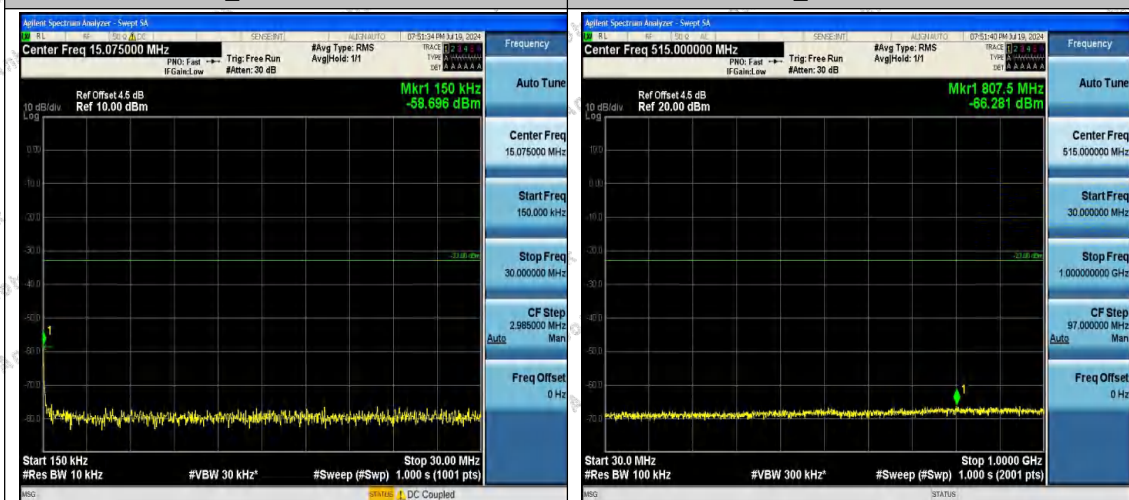

Band2_10MHz_16QAM_18900_1RB#0_0.15~30_0.15~30


Band2_10MHz_16QAM_18900_1RB#0_30~1000_30~1000

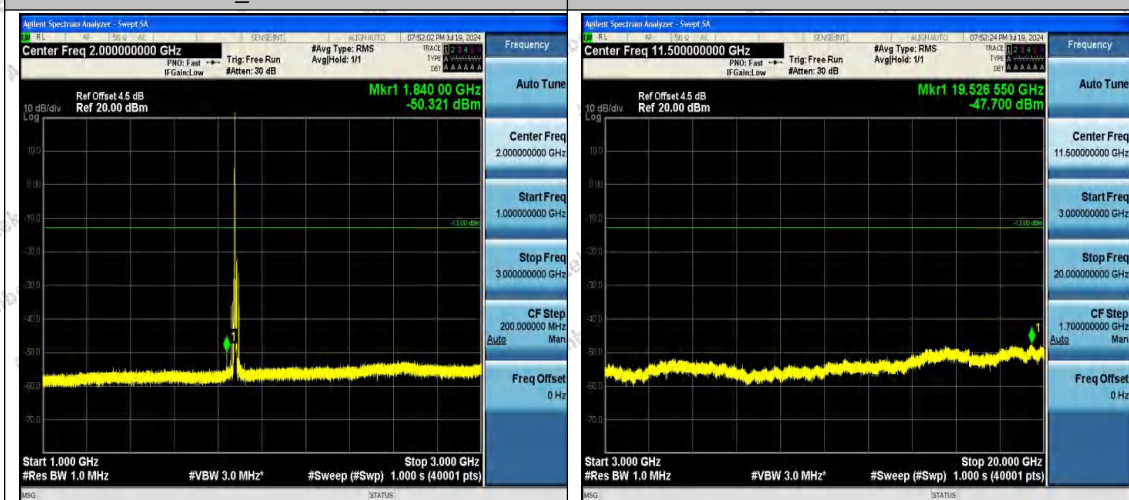

Band2_10MHz_16QAM_18900_1RB#0_1000~3000_00_1000~3000


Band2_10MHz_16QAM_18900_1RB#0_3000~2000_00_3000~20000



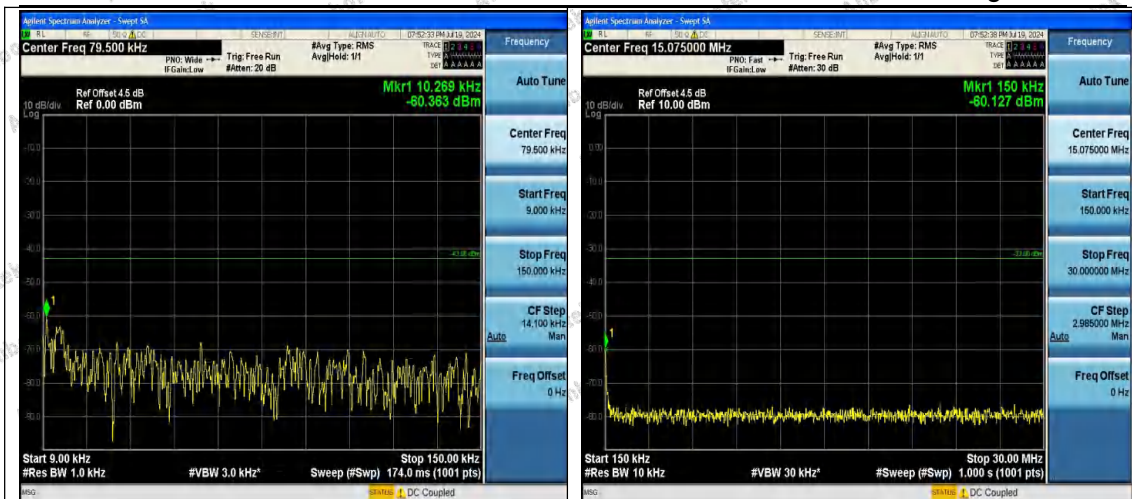


Band2_10MHz_QPSK_19150_1RB#0_0.009~0.1
5_0.009~0.15

Band2_10MHz_QPSK_19150_1RB#0_0.15~30_0.
15~30

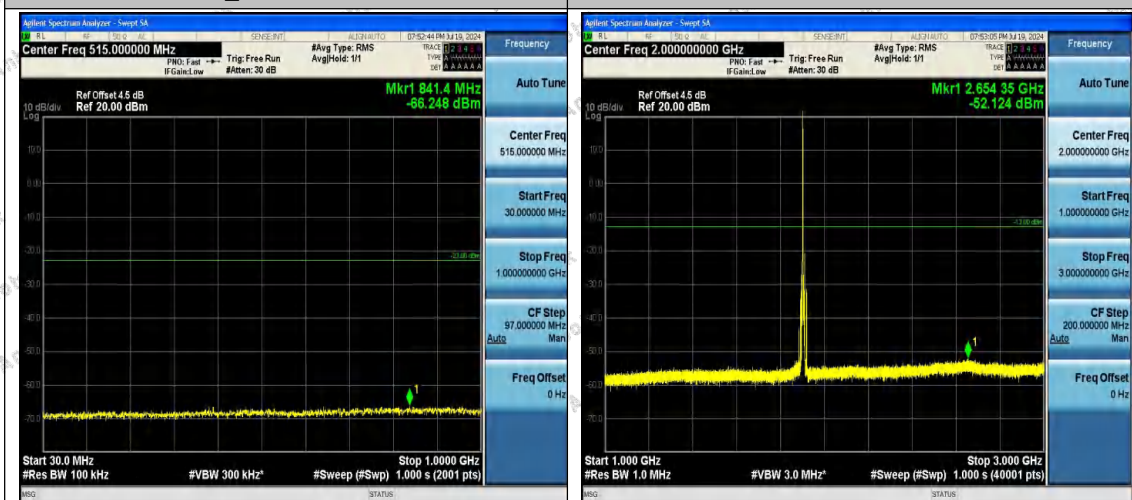

Band2_10MHz_QPSK_19150_1RB#0_30~1000_
30~1000


Band2_10MHz_QPSK_19150_1RB#0_1000~3000
_1000~3000

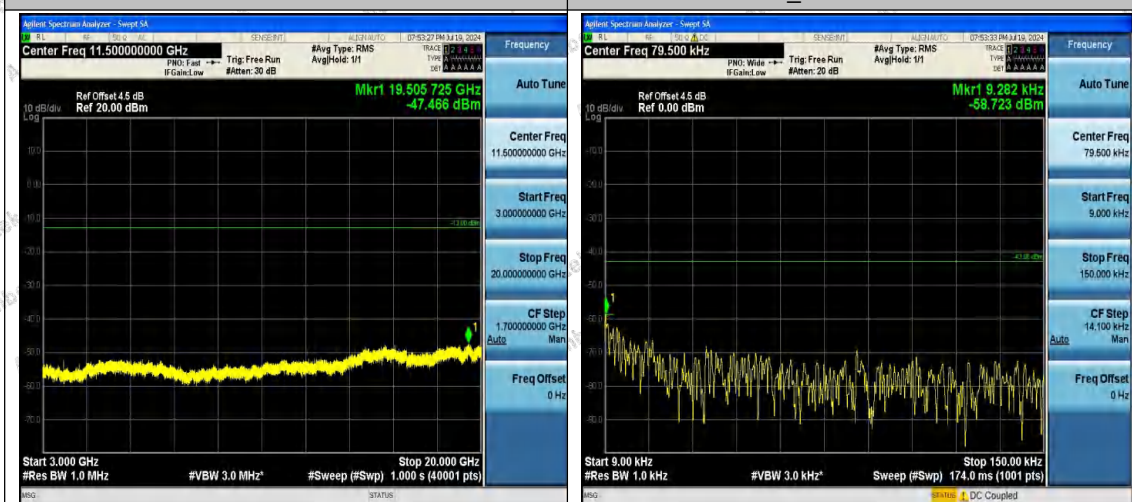



Band2_10MHz_QPSK_19150_1RB#0_3000~200
00_3000~20000

Band2_10MHz_16QAM_19150_1RB#0_0.009~0.1
5_0.009~0.15



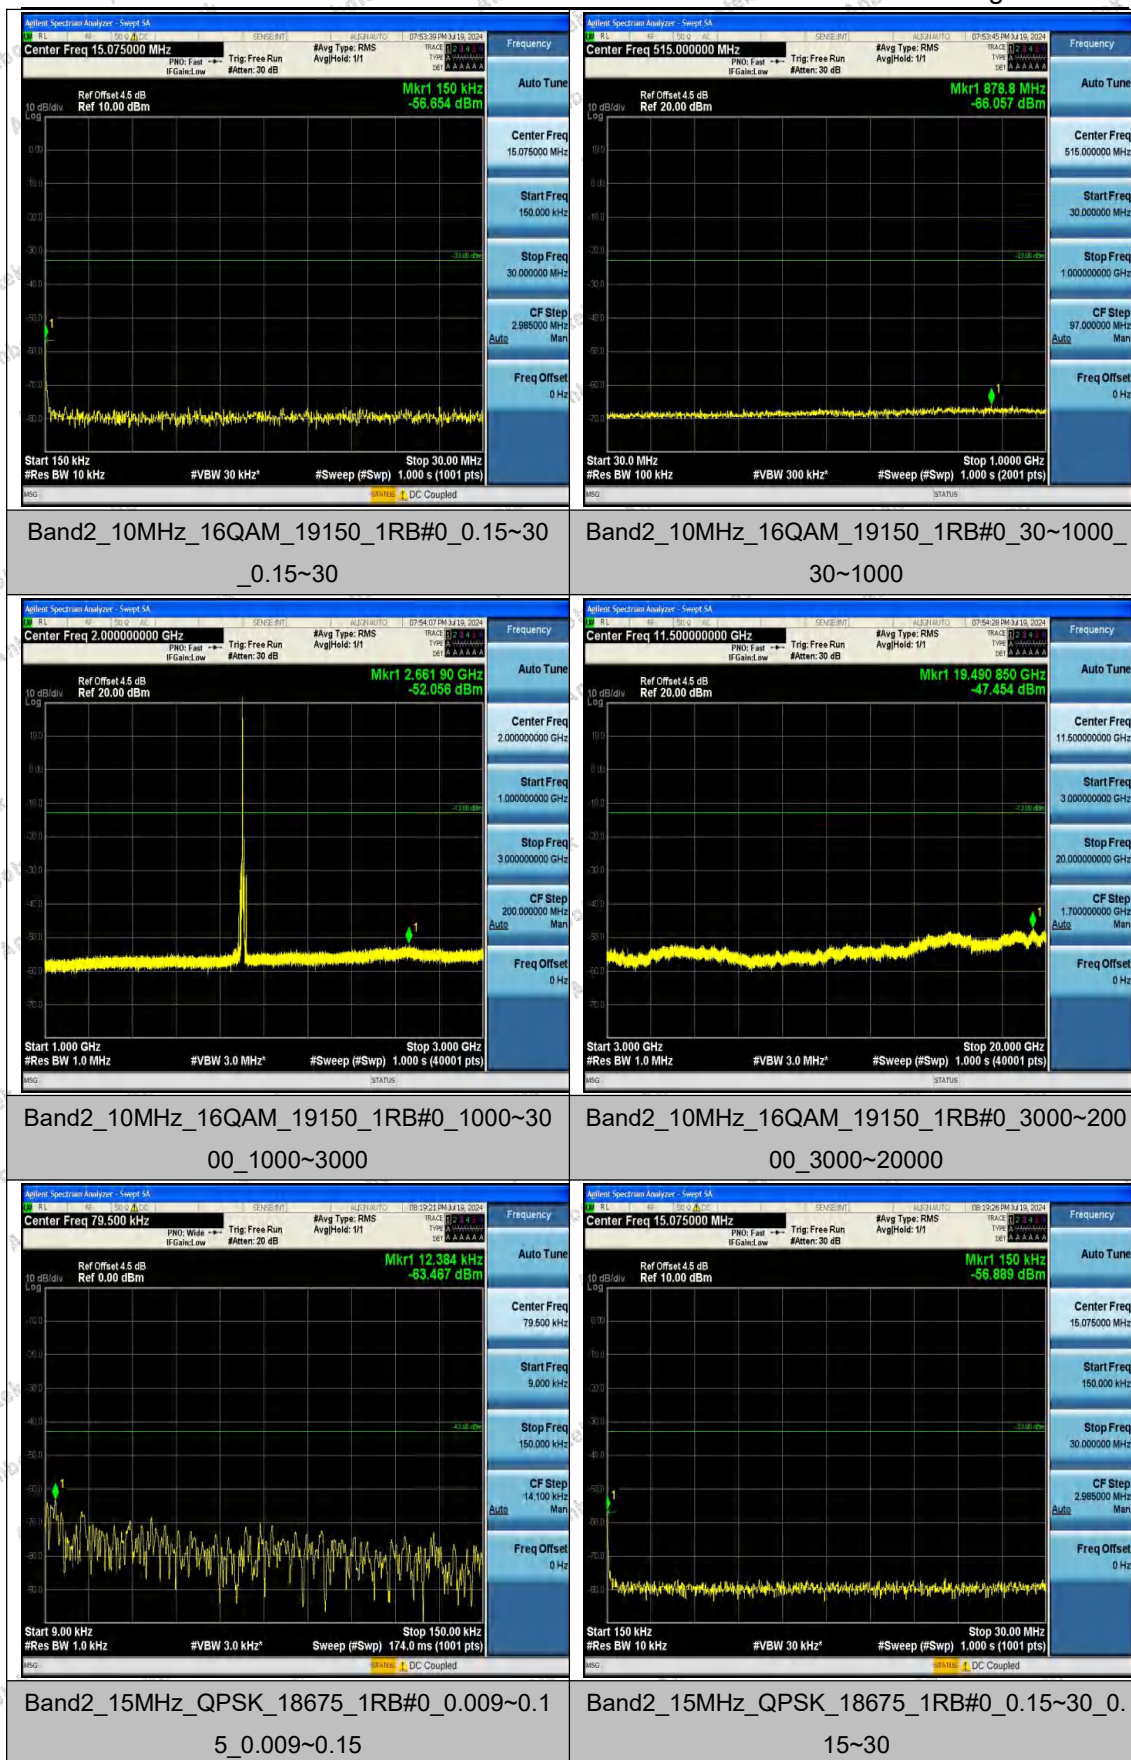


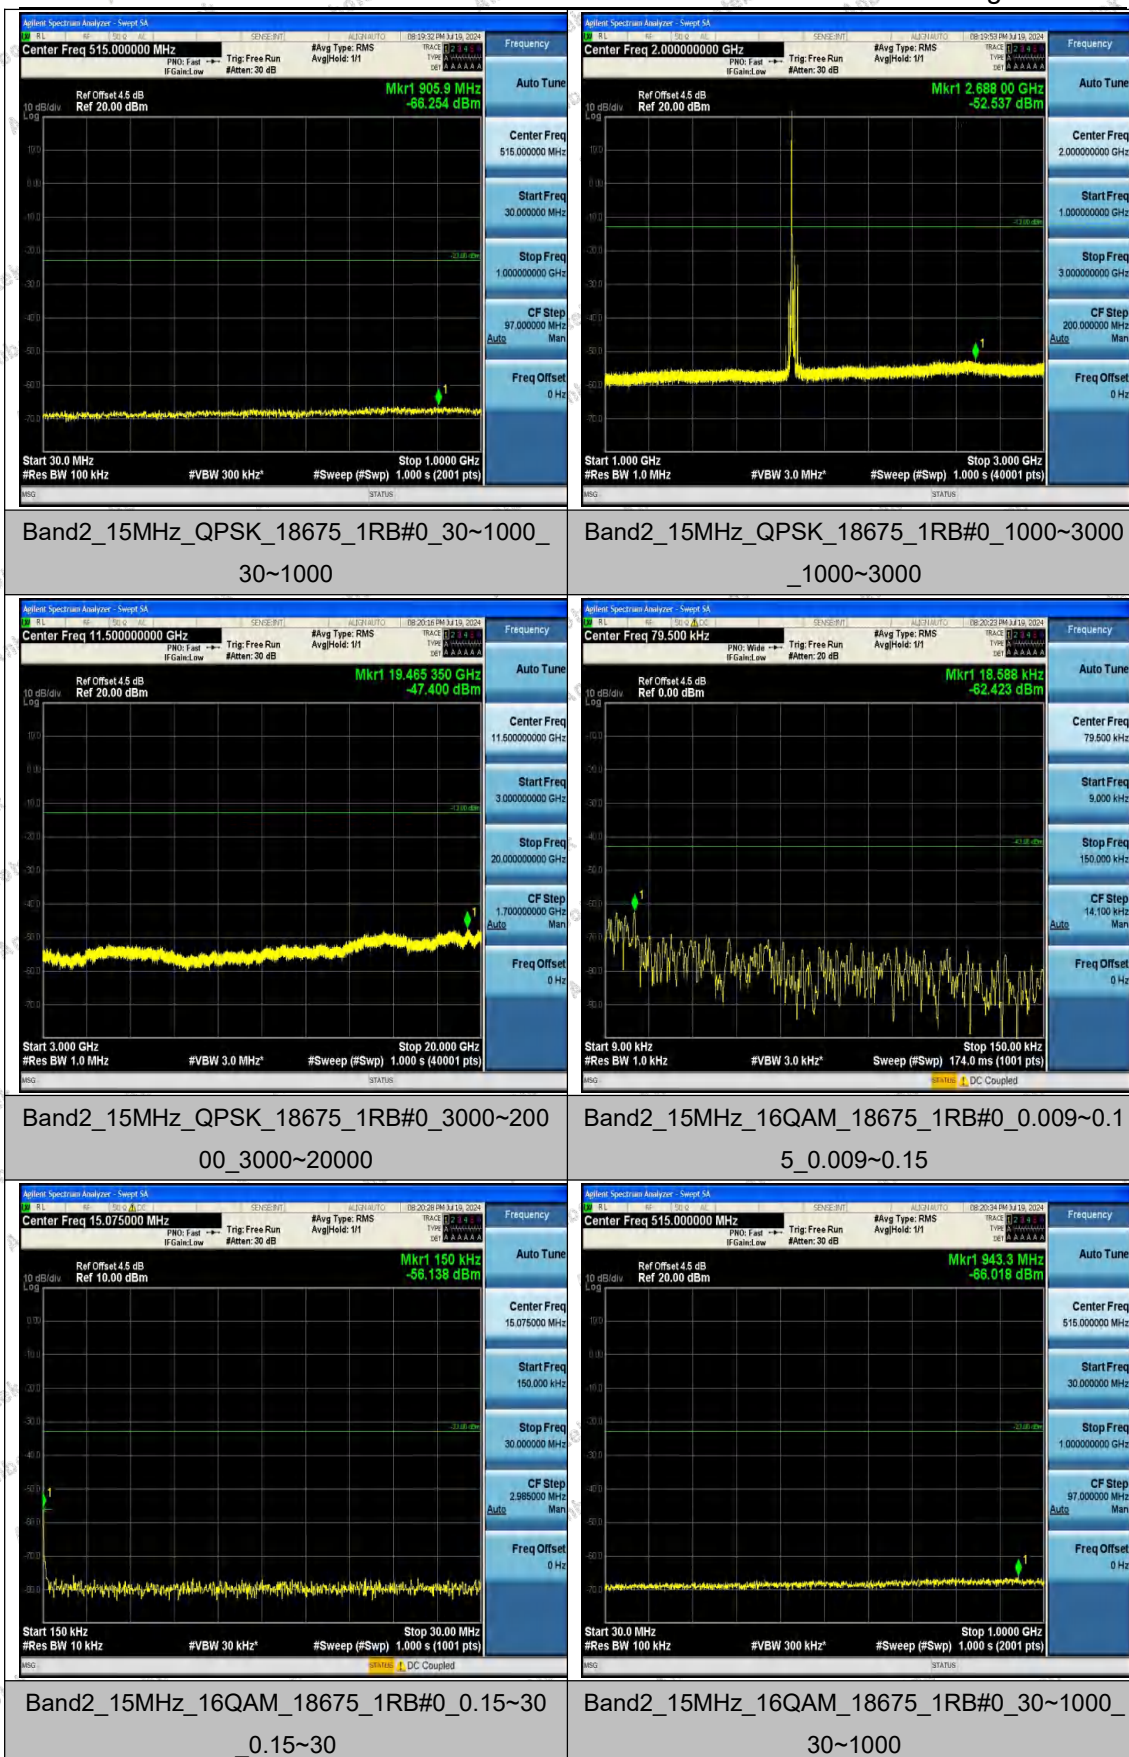

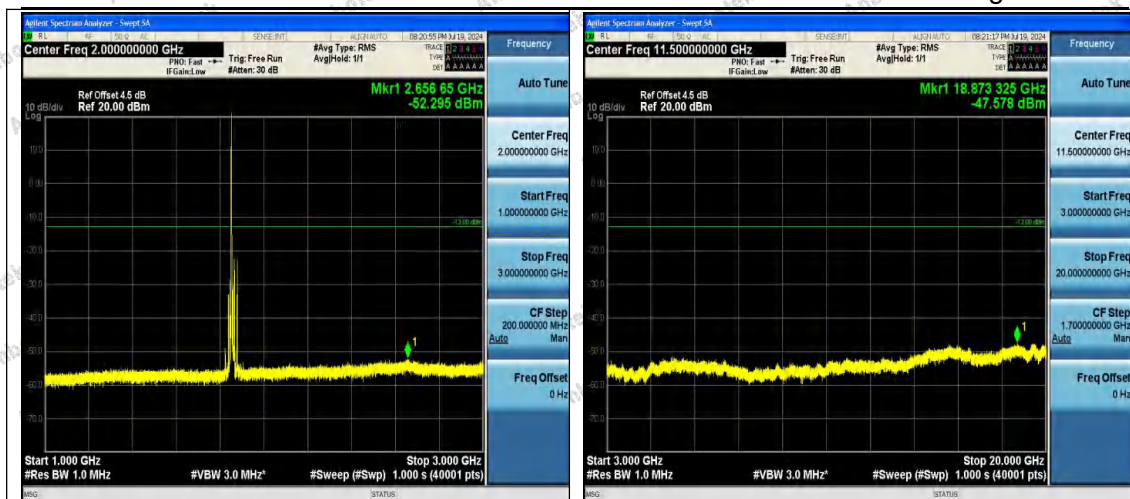


Band2_15MHz_16QAM_18675_1RB#0_1000~3000
00_1000~3000

Band2_15MHz_16QAM_18675_1RB#0_3000~20000
00_3000~20000

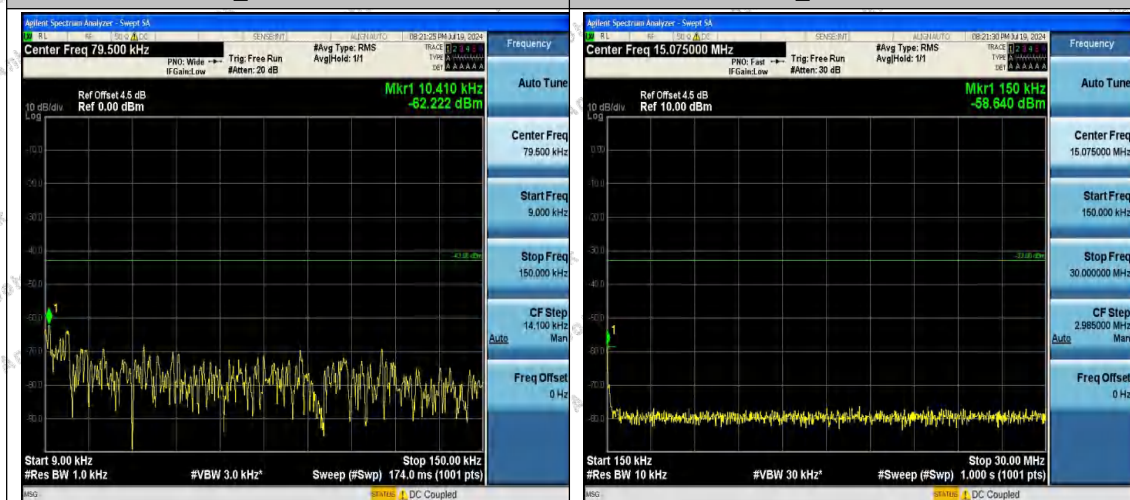

Band2_15MHz_QPSK_18900_1RB#0_0.009~0.1
5_0.009~0.15


Band2_15MHz_QPSK_18900_1RB#0_0.15~30_0.
15~30

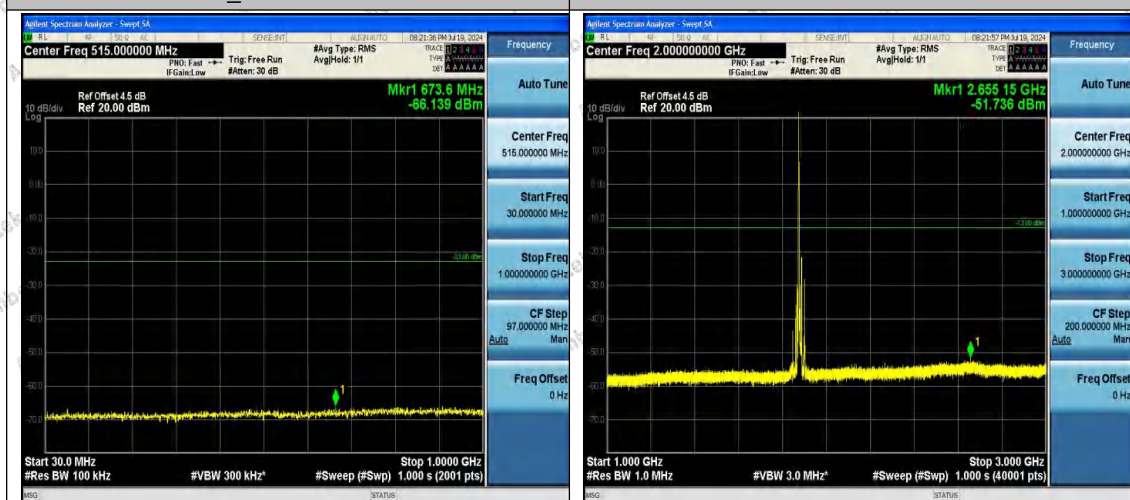

Band2_15MHz_QPSK_18900_1RB#0_30~1000
30~1000

Band2_15MHz_QPSK_18900_1RB#0_1000~3000
_1000~3000



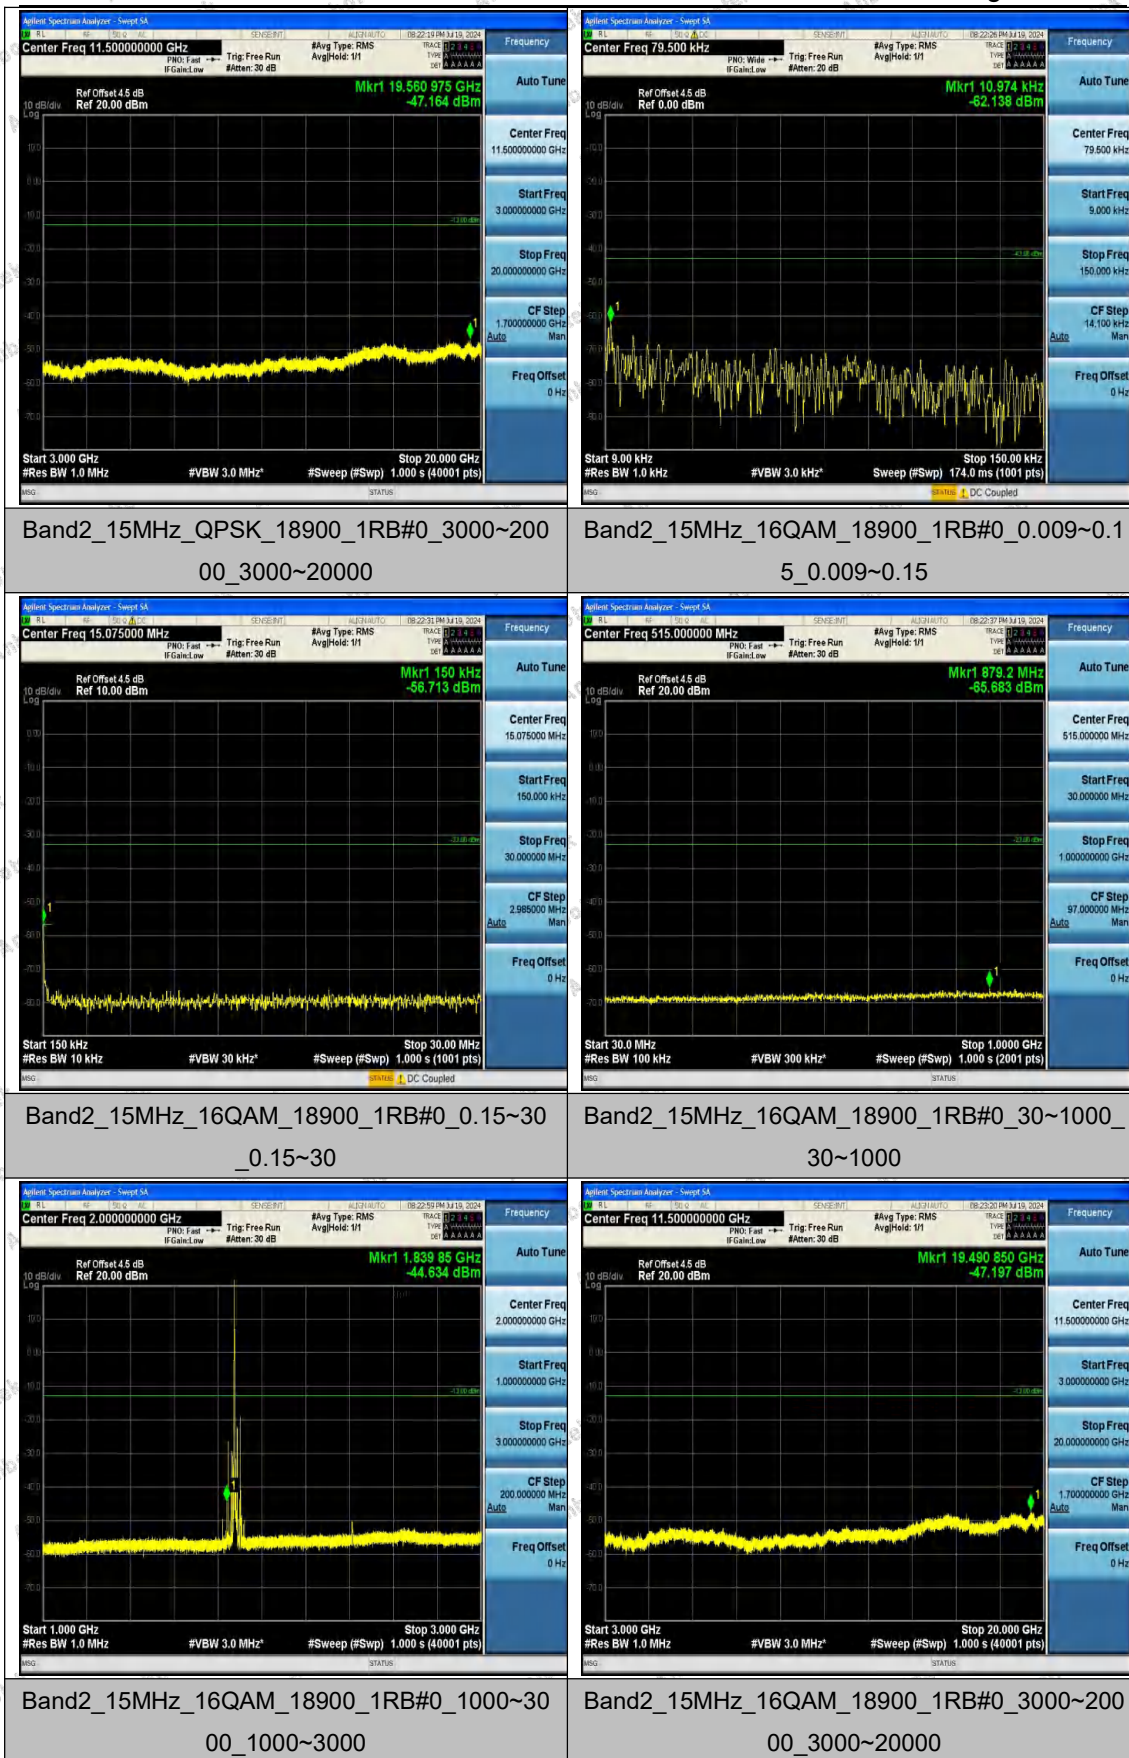


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com



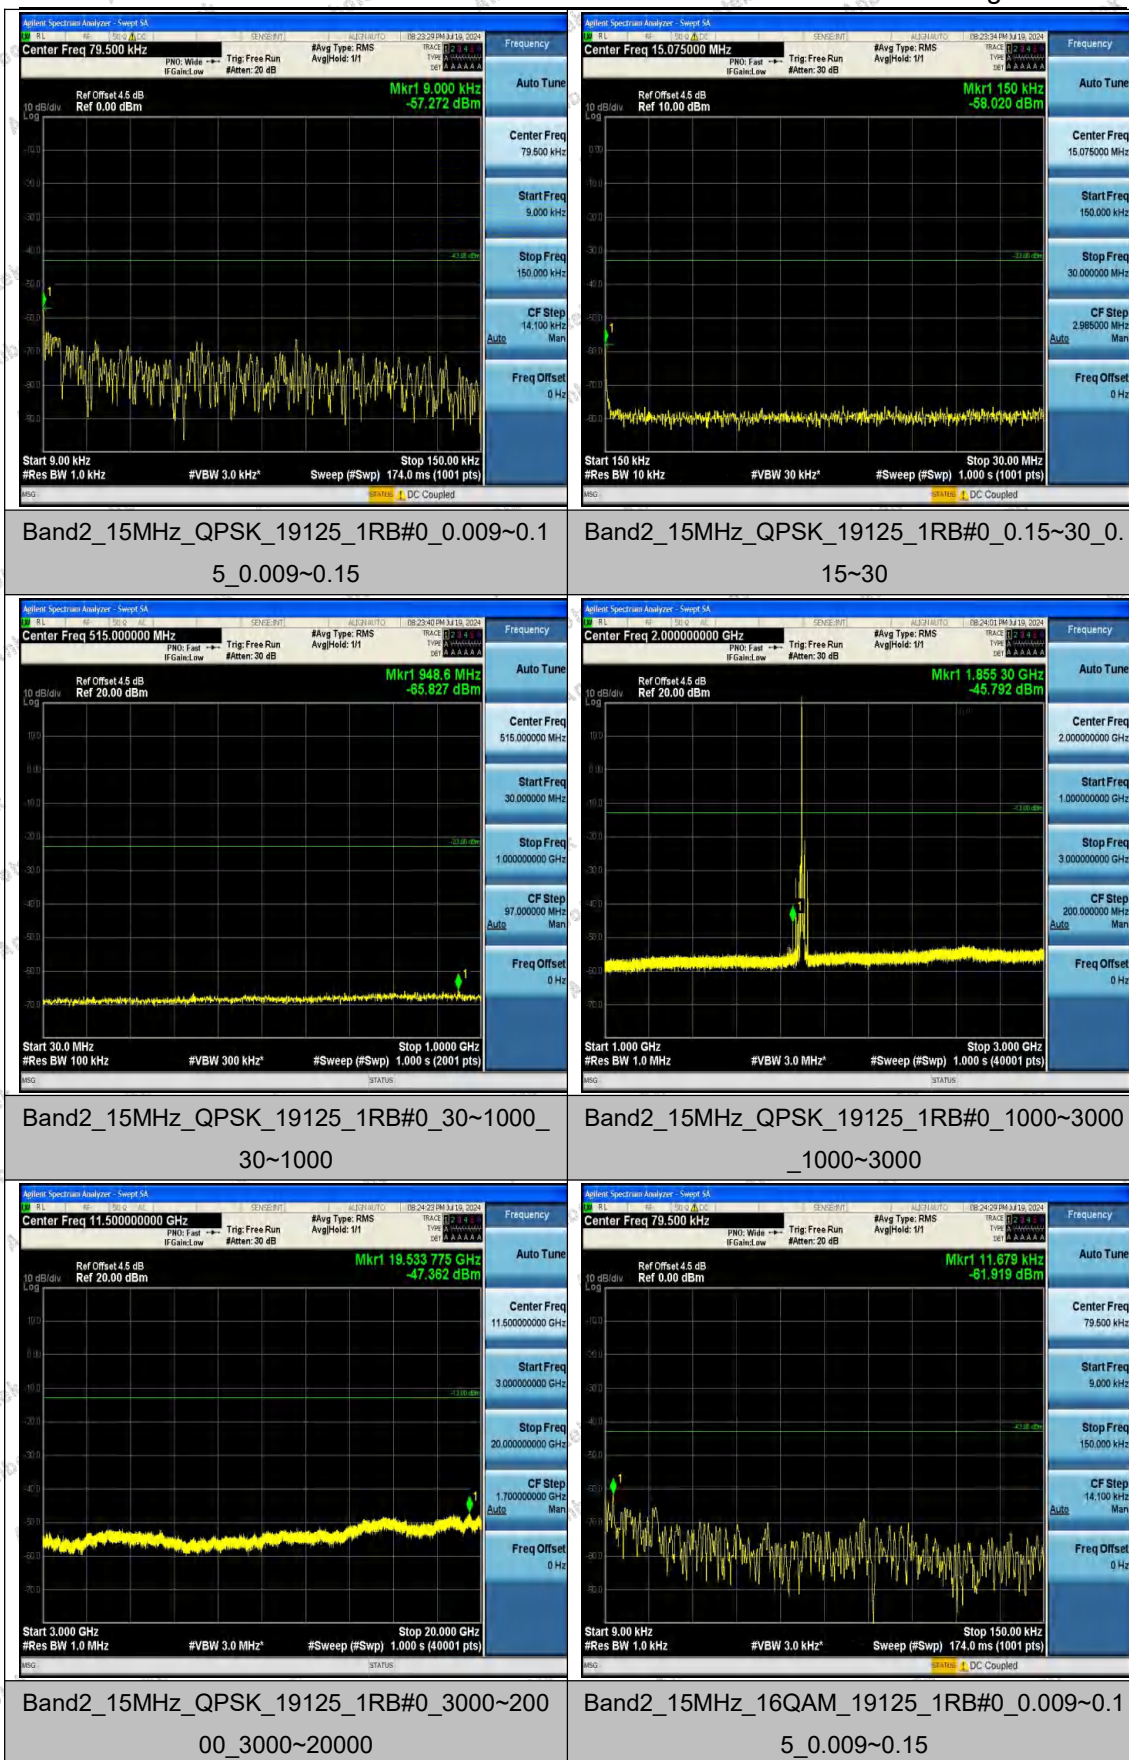


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com



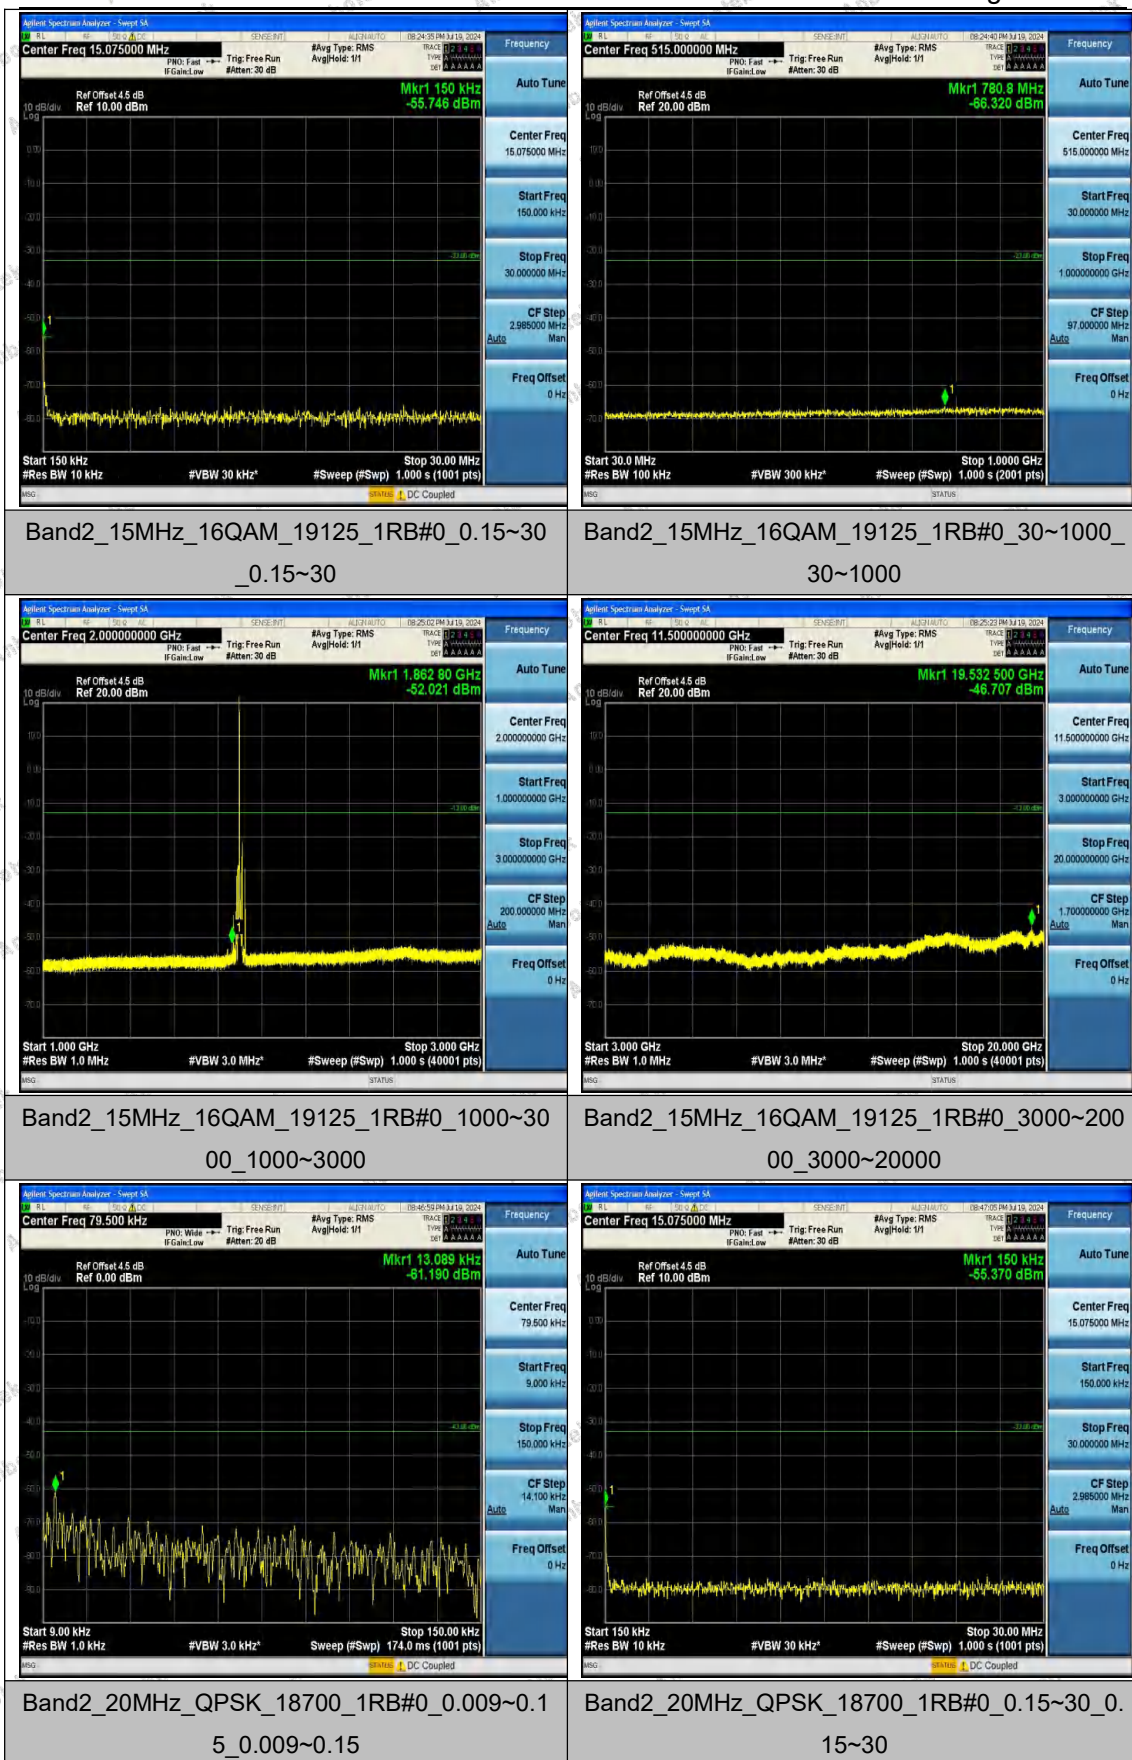

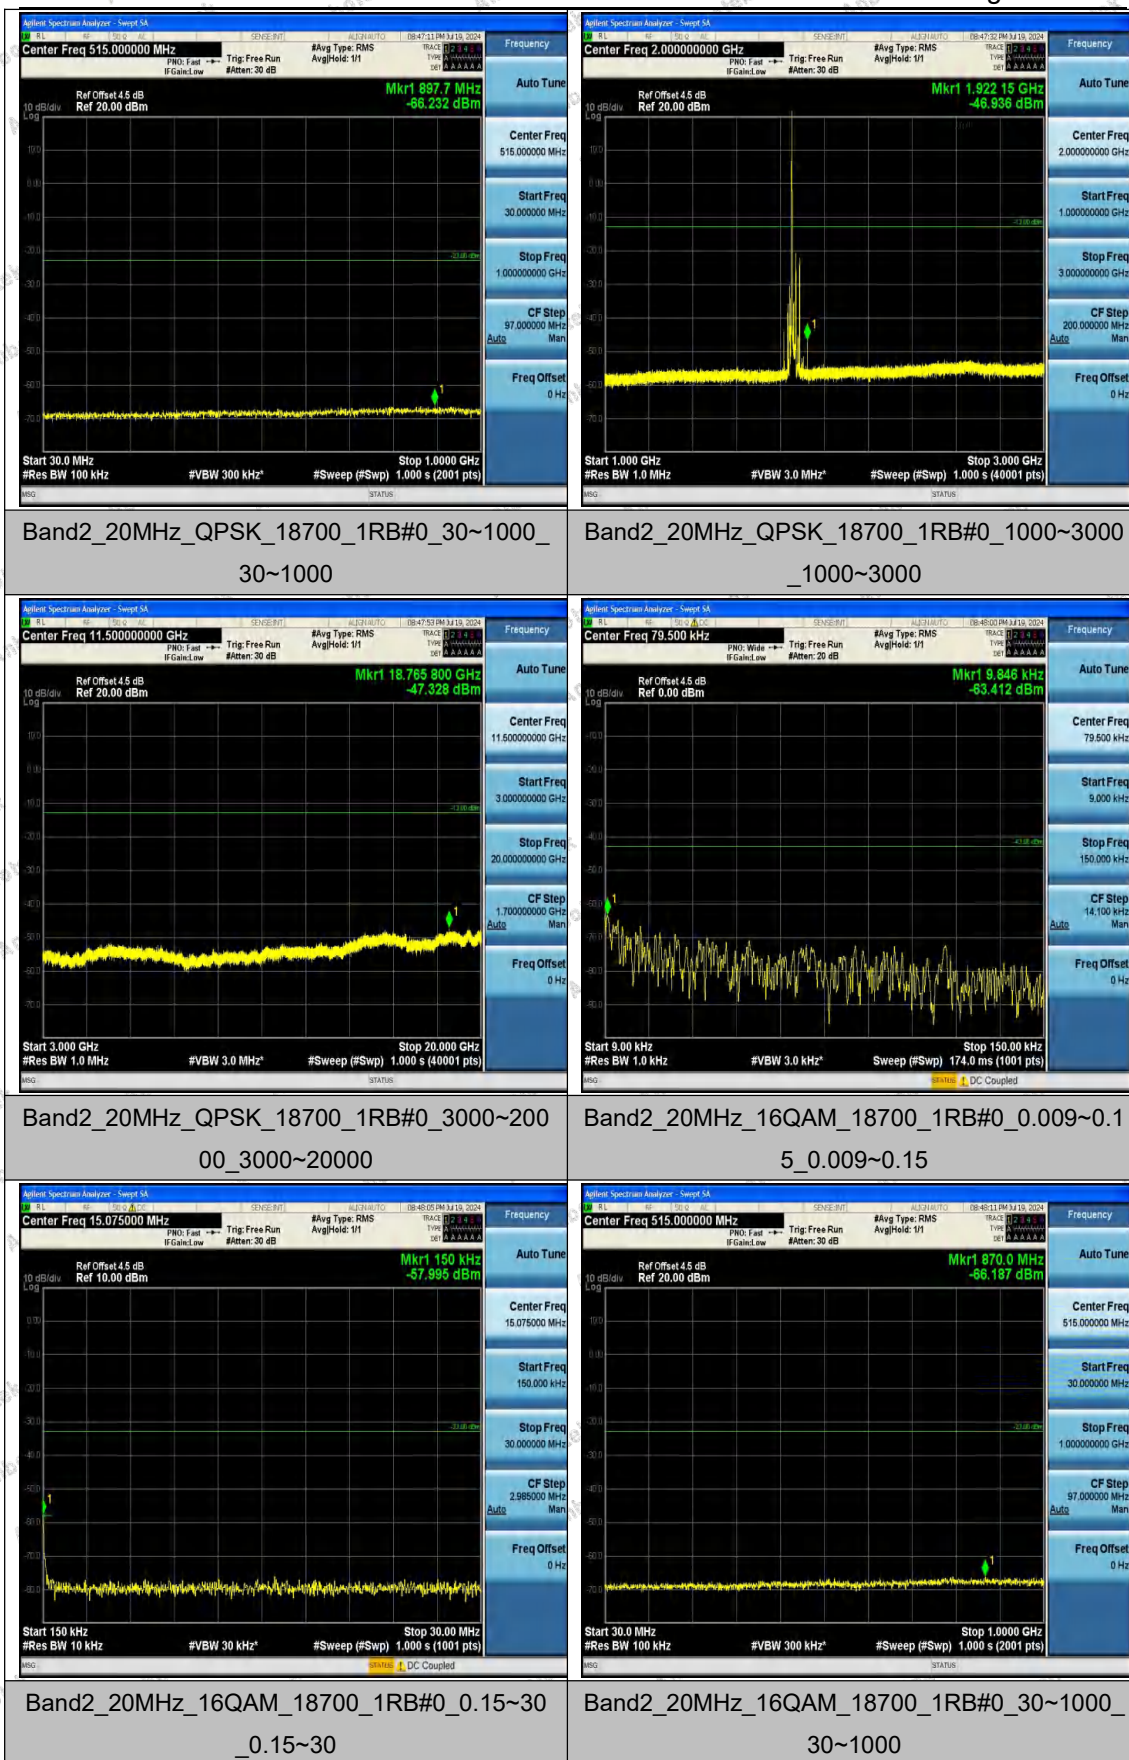

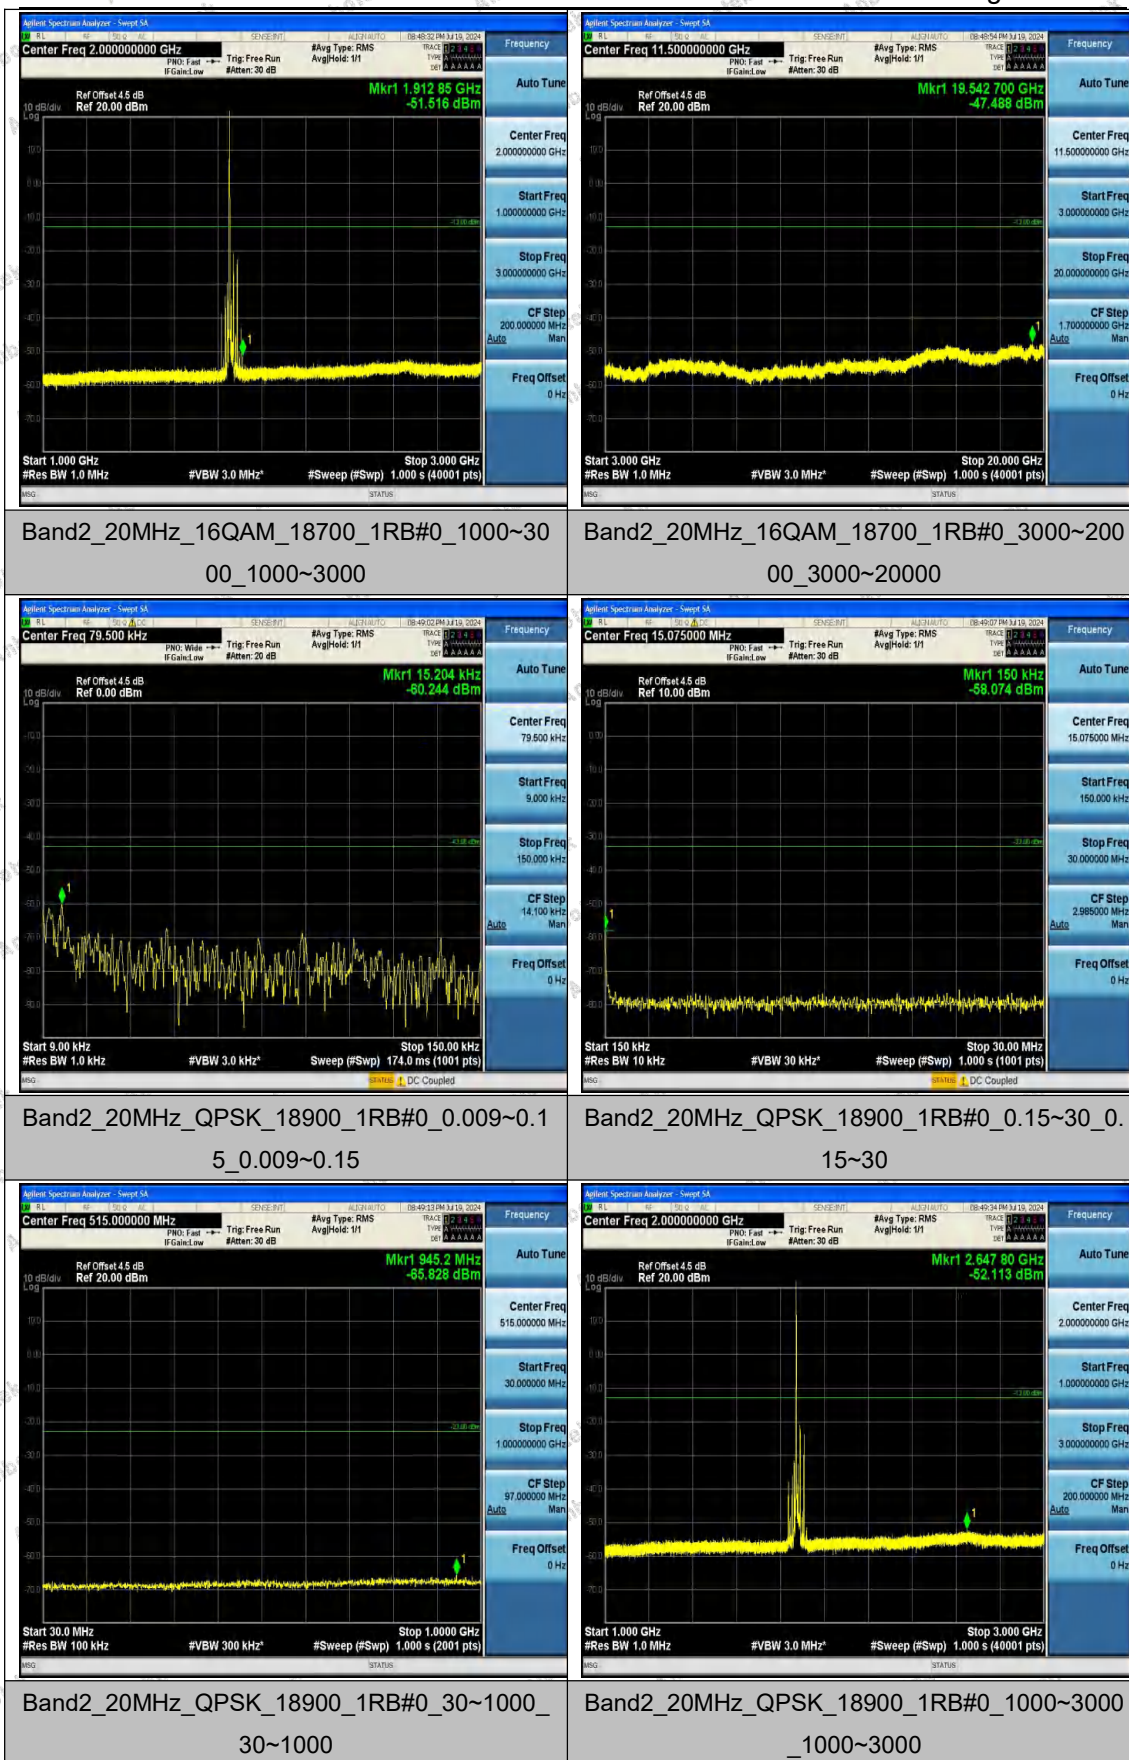

Band2_20MHz_16QAM_18700_1RB#0_1000~3000_1000~3000

Band2_20MHz_16QAM_18700_1RB#0_3000~20000_3000~20000


Band2_20MHz_QPSK_18900_1RB#0_0.009~0.15_0.009~0.15

Band2_20MHz_QPSK_18900_1RB#0_0.15~30_0.15~30

Band2_20MHz_QPSK_18900_1RB#0_30~1000_30~1000

Band2_20MHz_QPSK_18900_1RB#0_1000~3000_1000~3000



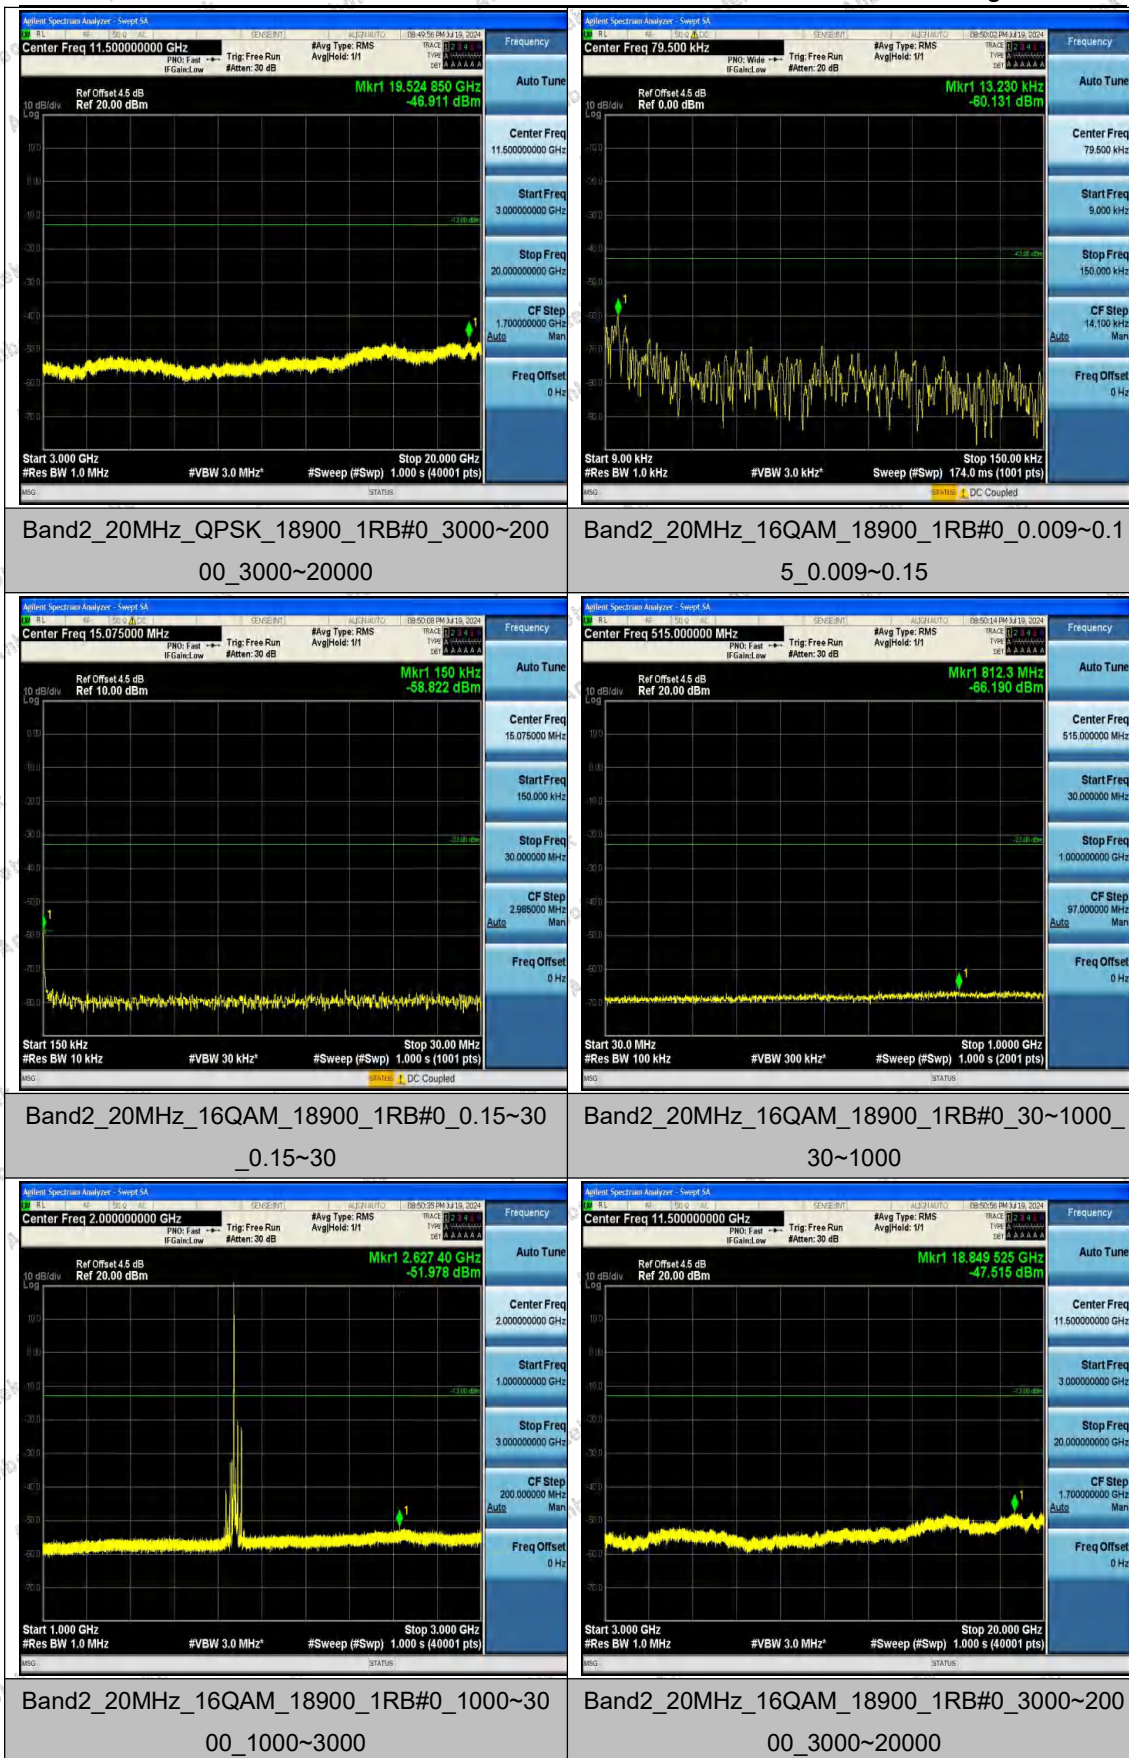


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com



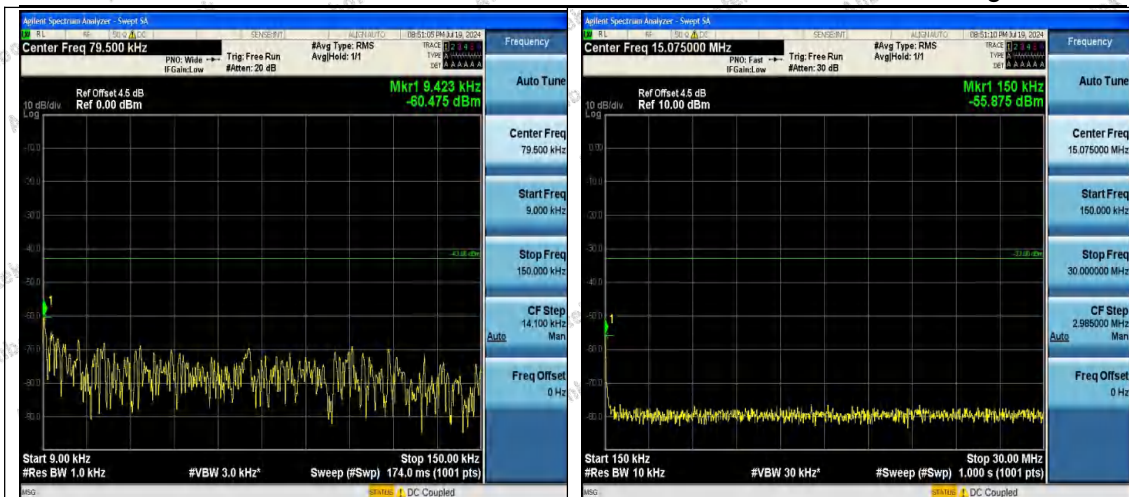


Band2_20MHz_QPSK_19100_1RB#0_0.009~0.1
5_0.009~0.15

Band2_20MHz_QPSK_19100_1RB#0_0.15~30_0.
15~30

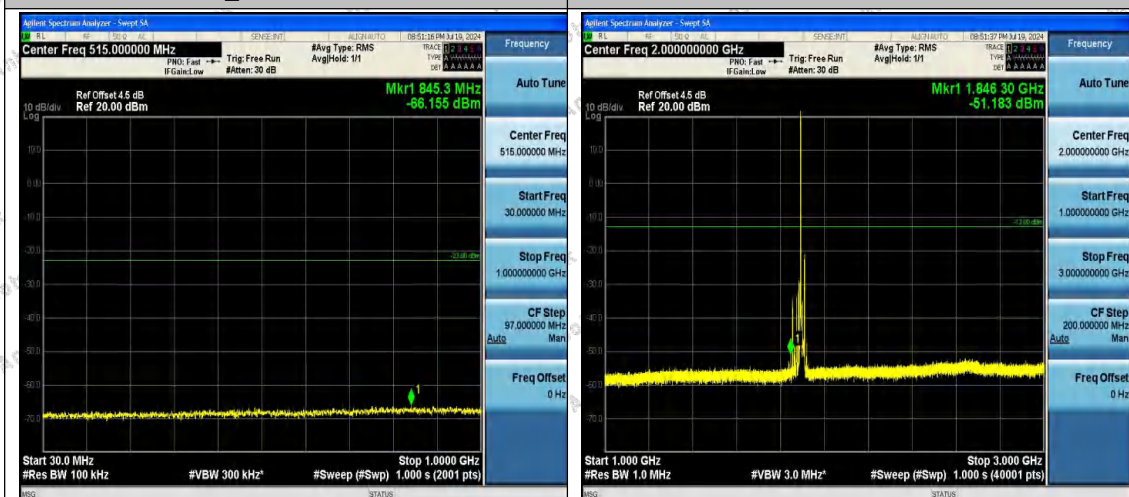

Band2_20MHz_QPSK_19100_1RB#0_30~1000_
30~1000

Band2_20MHz_QPSK_19100_1RB#0_1000~3000
_1000~3000

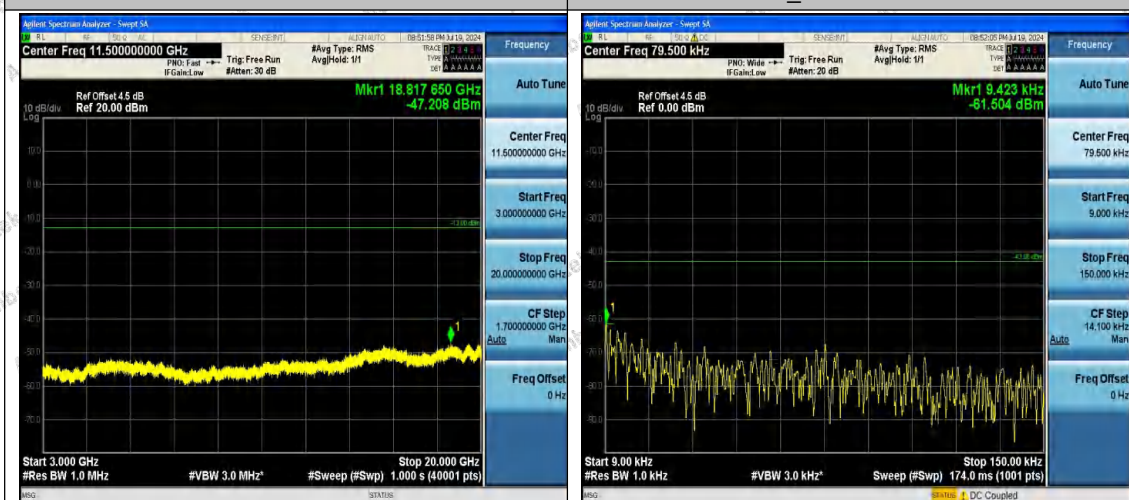

Band2_20MHz_QPSK_19100_1RB#0_3000~200
00_3000~20000

Band2_20MHz_16QAM_19100_1RB#0_0.009~0.1
5_0.009~0.15


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com



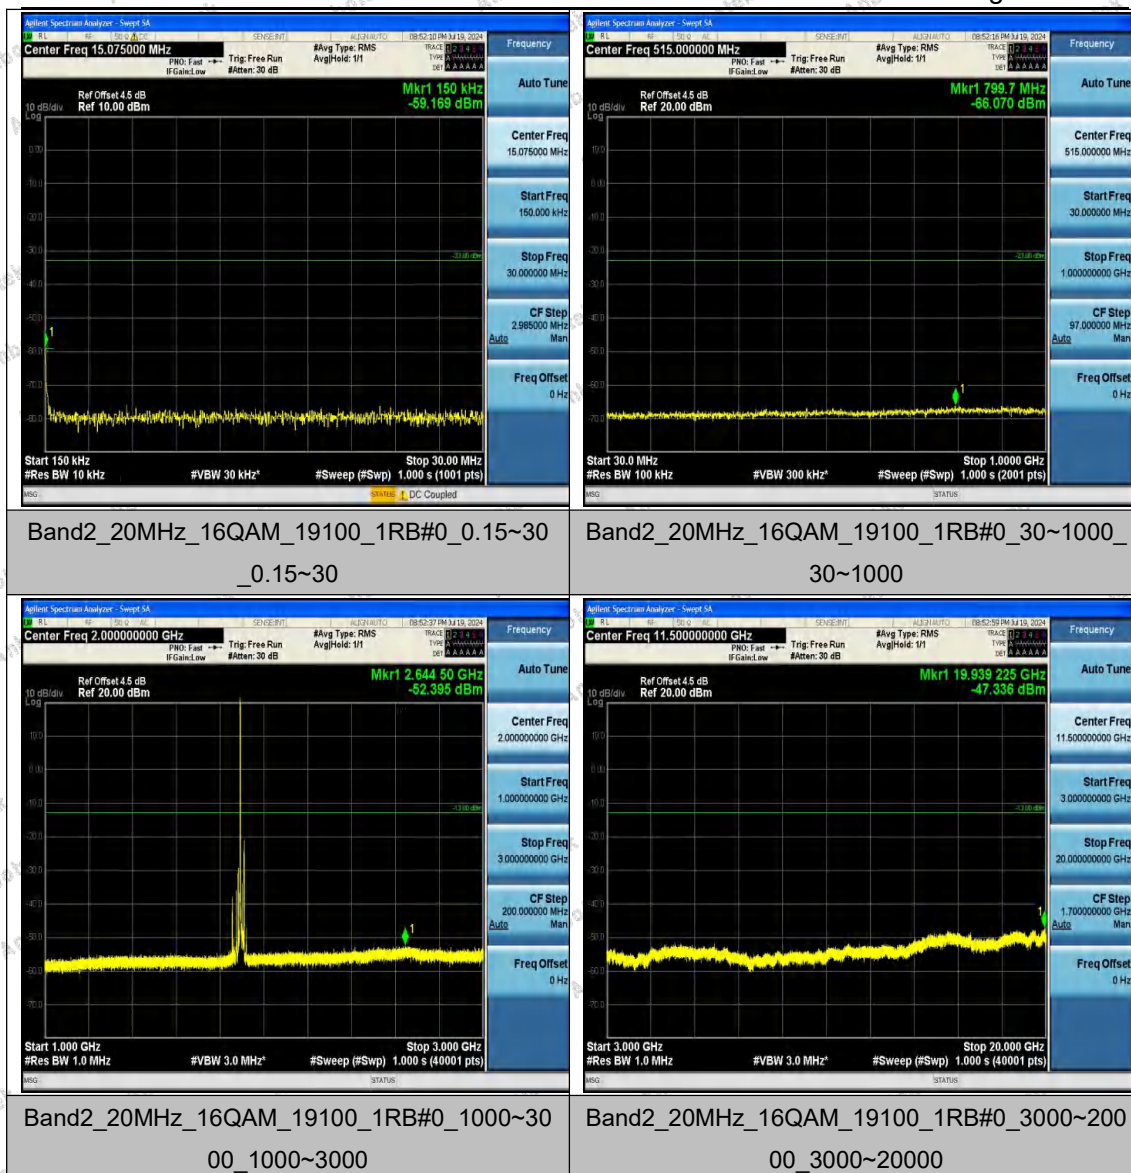

Appendix F: Frequency stability VS Voltage measurement

Test Result

Band	Bandwidth	Modulation	Channel	RB Configure	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	23.29	0.012584	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	20.94	0.011315	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	25.62	0.013843	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	7.82	0.004225	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	11.13	0.006014	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	11.97	0.006468	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	9.14	0.004862	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	11.76	0.006255	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	6.62	0.003521	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	2.30	0.001223	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	-6.14	-0.003266	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	7.84	0.004170	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	-12.16	-0.006369	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-8.68	-0.004546	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-6.61	-0.003462	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	7.47	0.003912	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	4.69	0.002456	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-5.78	-0.003027	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	6.44	0.003478	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	7.82	0.004224	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	5.91	0.003192	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	7.35	0.003970	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	4.39	0.002371	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	7.22	0.003900	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	4.26	0.002266	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	7.28	0.003872	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	6.92	0.003681	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	9.44	0.005021	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	8.48	0.004511	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	9.48	0.005043	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	10.40	0.005449	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	8.00	0.004192	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	4.88	0.002557	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	6.44	0.003374	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	8.34	0.004370	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	3MHz	16QAM	19185	15RB#0	VH	NT	7.81	0.004092	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VN	NT	4.33	0.002337	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	5.01	0.002704	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	9.90	0.005344	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	10.09	0.005447	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	4.15	0.002240	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	5.18	0.002796	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	5.41	0.002878	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	6.94	0.003691	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	6.48	0.003447	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	7.51	0.003995	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	6.05	0.003218	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	-2.26	-0.001202	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	-5.59	-0.002931	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-3.28	-0.001720	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-6.57	-0.003444	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-3.96	-0.002076	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-4.05	-0.002123	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-5.38	-0.002820	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-8.14	-0.004388	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	3.96	0.002135	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-5.88	-0.003170	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VN	NT	-5.48	-0.002954	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VL	NT	-3.59	-0.001935	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	VH	NT	-4.72	-0.002544	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	8.48	0.004511	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	7.22	0.003840	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	10.43	0.005548	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VN	NT	5.92	0.003149	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VL	NT	8.13	0.004324	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	VH	NT	3.72	0.001979	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	6.25	0.003281	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	7.30	0.003832	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	8.24	0.004325	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VN	NT	6.72	0.003528	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VL	NT	7.45	0.003911	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	VH	NT	3.18	0.001669	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	3.39	0.001825	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	4.39	0.002363	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	2.29	0.001233	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VN	NT	3.68	0.001981	±2.5	PASS



Band2	15MHz	16QAM	18675	75RB#0	VL	NT	4.48	0.002412	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	VH	NT	3.32	0.001787	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	5.49	0.002920	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	5.14	0.002734	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	4.39	0.002335	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VN	NT	4.15	0.002207	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VL	NT	-6.74	-0.003585	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	VH	NT	-4.11	-0.002186	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	5.15	0.002707	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	5.25	0.002760	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	4.49	0.002360	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VN	NT	6.88	0.003616	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VL	NT	5.15	0.002707	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	VH	NT	6.07	0.003191	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	4.94	0.002656	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	5.32	0.002860	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	9.36	0.005032	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VN	NT	7.05	0.003790	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VL	NT	4.56	0.002452	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	VH	NT	4.95	0.002661	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	3.78	0.002011	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	3.30	0.001755	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VH	NT	7.70	0.004096	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VN	NT	5.97	0.003176	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VL	NT	4.62	0.002457	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	VH	NT	4.58	0.002436	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-4.82	-0.002537	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-3.19	-0.001679	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-3.35	-0.001763	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VN	NT	-7.00	-0.003684	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VL	NT	-4.33	-0.002279	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	VH	NT	-4.55	-0.002395	±2.5	PASS



Appendix G: Frequency stability VS Temperature measurement

Test Result

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	27.32	0.014762	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	29.20	0.015778	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	21.54	0.011639	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	26.42	0.014276	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	23.49	0.012692	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	19.66	0.010623	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	16.55	0.008943	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	14.95	0.008078	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	12.30	0.006646	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	9.76	0.005274	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	8.58	0.004636	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	5.92	0.003199	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-3.60	-0.001945	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	6.75	0.003647	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	4.28	0.002313	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	-4.65	-0.002513	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	5.69	0.003075	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	-3.72	-0.002010	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	8.05	0.004282	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	7.61	0.004048	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	7.01	0.003729	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	6.71	0.003569	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	5.08	0.002702	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	3.00	0.001596	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	5.22	0.002777	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	-3.73	-0.001984	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	6.34	0.003372	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-4.58	-0.002436	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-4.33	-0.002303	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	-5.79	-0.003080	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	4.48	0.002383	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	4.84	0.002574	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-7.44	-0.003957	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	-7.67	-0.004080	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	-7.07	-0.003761	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	-6.35	-0.003378	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-6.95	-0.003640	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-6.21	-0.003253	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	3.23	0.001692	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-5.87	-0.003074	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-8.48	-0.004441	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-9.17	-0.004803	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	-5.45	-0.002854	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	-5.19	-0.002718	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	4.35	0.002278	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	4.41	0.002310	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-6.39	-0.003347	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	5.15	0.002697	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-6.05	-0.003169	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	5.08	0.002661	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	3.32	0.001739	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	4.41	0.002310	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	4.88	0.002556	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	-4.58	-0.002399	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	6.19	0.003343	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	5.89	0.003181	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	9.94	0.005369	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	7.68	0.004148	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	9.66	0.005217	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	5.16	0.002787	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	7.01	0.003786	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	6.98	0.003770	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	7.42	0.004008	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	4.38	0.002366	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	6.28	0.003392	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	4.75	0.002565	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	-4.26	-0.002301	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	7.82	0.004224	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	-5.95	-0.003214	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	5.66	0.003057	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	4.41	0.002382	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	5.84	0.003154	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	6.32	0.003362	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
 Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
 400-003-0500

www.anbotek.com



Band2	3MHz	QPSK	18900	15RB#0	NV	-20	6.98	0.003713	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	5.29	0.002814	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	5.18	0.002755	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	3.60	0.001915	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	5.61	0.002984	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	7.84	0.004170	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	5.24	0.002787	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	7.35	0.003910	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	7.44	0.003957	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	7.97	0.004239	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	9.40	0.005000	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	6.01	0.003197	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	7.38	0.003926	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	7.71	0.004101	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	10.07	0.005356	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	12.36	0.006574	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	6.79	0.003612	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	5.76	0.003018	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	6.52	0.003416	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-10	7.22	0.003783	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	6.52	0.003416	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	5.62	0.002945	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	9.11	0.004773	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	6.54	0.003427	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	40	7.44	0.003898	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	4.63	0.002426	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	9.83	0.005151	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	11.23	0.005884	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	7.82	0.004097	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	7.22	0.003783	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	3.89	0.002038	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	7.82	0.004097	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	9.66	0.005062	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	7.31	0.003830	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	4.99	0.002615	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	8.97	0.004842	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	7.90	0.004265	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	5.68	0.003066	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	5.02	0.002710	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	3.10	0.001673	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	3.00	0.001619	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86)0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	5MHz	QPSK	18625	25RB#0	NV	30	7.57	0.004086	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	40	5.54	0.002991	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	6.11	0.003298	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	3.96	0.002138	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	7.91	0.004270	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	7.11	0.003838	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	6.52	0.003520	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	6.84	0.003692	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	9.00	0.004858	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	7.84	0.004232	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	7.70	0.004157	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	6.74	0.003638	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	6.45	0.003431	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	2.88	0.001532	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	6.22	0.003309	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	4.26	0.002266	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	7.68	0.004085	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-4.33	-0.002303	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	8.31	0.004420	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	4.09	0.002176	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	5.25	0.002793	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	4.18	0.002223	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	6.11	0.003250	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	4.86	0.002585	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	4.59	0.002441	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	3.13	0.001665	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-2.45	-0.001303	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	7.81	0.004154	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	6.57	0.003495	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	6.07	0.003229	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-7.52	-0.003942	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-5.04	-0.002642	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	-6.62	-0.003471	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-5.29	-0.002773	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-5.21	-0.002731	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-4.82	-0.002527	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	2.60	0.001363	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	-4.96	-0.002600	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	-6.71	-0.003518	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	-4.06	-0.002128	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-5.66	-0.002967	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	5MHz	16QAM	19175	25RB#0	NV	-10	-7.93	-0.004157	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	0	3.16	0.001657	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-6.65	-0.003486	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	4.28	0.002244	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	-4.56	-0.002391	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	40	-3.28	-0.001720	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	-5.72	-0.002999	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-5.48	-0.002954	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-2.80	-0.001509	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	-4.23	-0.002280	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	4.33	0.002334	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-5.84	-0.003148	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	-5.09	-0.002744	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	-4.32	-0.002329	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	5.04	0.002717	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	-6.24	-0.003364	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-30	-5.19	-0.002798	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-20	-4.11	-0.002216	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	-10	-3.85	-0.002075	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	0	-4.78	-0.002577	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	10	-6.34	-0.003418	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	20	-5.59	-0.003013	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	30	3.02	0.001628	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	40	-3.93	-0.002119	±2.5	PASS
Band2	10MHz	16QAM	18650	50RB#0	NV	50	-5.51	-0.002970	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	3.83	0.002037	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	3.38	0.001798	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	4.16	0.002213	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	8.43	0.004484	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	8.03	0.004271	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	7.81	0.004154	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	6.65	0.003537	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	5.75	0.003059	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	8.31	0.004420	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-30	6.34	0.003372	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-20	6.44	0.003426	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	-10	7.34	0.003904	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	0	3.60	0.001915	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	10	-2.78	-0.001479	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	20	4.73	0.002516	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	30	3.09	0.001644	±2.5	PASS

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500

www.anbotech.com



Band2	10MHz	16QAM	18900	50RB#0	NV	40	3.09	0.001644	±2.5	PASS
Band2	10MHz	16QAM	18900	50RB#0	NV	50	5.01	0.002665	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	3.85	0.002021	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	6.69	0.003512	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	-3.25	-0.001706	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	4.95	0.002598	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	7.38	0.003874	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	5.26	0.002761	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	5.02	0.002635	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	5.94	0.003118	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	8.03	0.004215	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-30	4.16	0.002184	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-20	6.98	0.003664	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	-10	4.41	0.002315	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	0	5.89	0.003092	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	10	7.54	0.003958	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	20	5.61	0.002945	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	30	8.48	0.004451	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	40	5.65	0.002966	±2.5	PASS
Band2	10MHz	16QAM	19150	50RB#0	NV	50	5.97	0.003134	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	4.75	0.002557	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-3.79	-0.002040	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	-2.69	-0.001448	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	6.62	0.003564	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-1.50	-0.000808	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-3.42	-0.001841	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	3.66	0.001970	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	40	-4.12	-0.002218	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	50	7.17	0.003860	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-30	3.39	0.001825	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-20	4.05	0.002180	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	-10	4.88	0.002627	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	0	1.99	0.001071	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	10	7.91	0.004258	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	20	5.95	0.003203	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	30	-3.19	-0.001717	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	40	-3.12	-0.001680	±2.5	PASS
Band2	15MHz	16QAM	18675	75RB#0	NV	50	3.82	0.002057	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	5.64	0.003000	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	4.81	0.002559	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	6.92	0.003681	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	15MHz	QPSK	18900	75RB#0	NV	0	3.99	0.002122	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	3.99	0.002122	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	6.02	0.003202	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	6.79	0.003612	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	3.71	0.001973	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	-3.82	-0.002032	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-30	5.68	0.003021	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-20	4.89	0.002601	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	-10	5.41	0.002878	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	0	3.76	0.002000	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	10	5.55	0.002952	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	20	6.05	0.003218	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	30	5.16	0.002745	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	40	-5.26	-0.002798	±2.5	PASS
Band2	15MHz	16QAM	18900	75RB#0	NV	50	3.60	0.001915	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	3.81	0.002003	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	3.88	0.002039	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	7.02	0.003690	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	5.81	0.003054	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	3.55	0.001866	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	5.56	0.002922	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	2.86	0.001503	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	7.34	0.003858	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	4.45	0.002339	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-30	5.59	0.002938	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-20	4.53	0.002381	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	-10	3.45	0.001813	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	0	5.87	0.003085	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	10	5.56	0.002922	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	20	5.22	0.002744	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	30	4.41	0.002318	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	40	5.06	0.002660	±2.5	PASS
Band2	15MHz	16QAM	19125	75RB#0	NV	50	7.37	0.003874	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	7.62	0.004097	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	8.44	0.004538	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	7.50	0.004032	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	9.84	0.005290	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	8.13	0.004371	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	7.87	0.004231	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	6.14	0.003301	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	6.05	0.003253	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hahgcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China.

Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com



Band2	20MHz	QPSK	18700	100RB#0	NV	50	4.42	0.002376	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-30	5.31	0.002855	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-20	-3.60	-0.001935	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	-10	7.51	0.004038	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	0	9.97	0.005360	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	10	5.48	0.002946	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	20	4.98	0.002677	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	30	5.55	0.002984	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	40	-3.20	-0.001720	±2.5	PASS
Band2	20MHz	16QAM	18700	100RB#0	NV	50	8.24	0.004430	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	5.85	0.003112	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	3.26	0.001734	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	3.35	0.001782	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	4.91	0.002612	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	3.30	0.001755	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	4.42	0.002351	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	-4.53	-0.002410	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	5.41	0.002878	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	-4.39	-0.002335	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-30	5.21	0.002771	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-20	4.38	0.002330	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	-10	7.25	0.003856	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	0	-5.75	-0.003059	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	10	4.05	0.002154	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	20	4.21	0.002239	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	30	5.02	0.002670	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	40	3.28	0.001745	±2.5	PASS
Band2	20MHz	16QAM	18900	100RB#0	NV	50	-1.63	-0.000867	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-5.49	-0.002889	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-3.22	-0.001695	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	-5.69	-0.002995	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-6.02	-0.003168	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	10	-5.14	-0.002705	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-7.18	-0.003779	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	-5.62	-0.002958	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	-3.42	-0.001800	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	-6.32	-0.003326	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-30	-4.15	-0.002184	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-20	-6.78	-0.003568	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	-10	4.29	0.002258	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	0	-4.55	-0.002395	±2.5	PASS



Band2	20MHz	16QAM	19100	100RB#0	NV	10	-3.20	-0.001684	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	20	-4.88	-0.002568	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	30	-4.58	-0.002411	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	40	-4.19	-0.002205	±2.5	PASS
Band2	20MHz	16QAM	19100	100RB#0	NV	50	-5.11	-0.002689	±2.5	PASS

---END---

