

Appendix Test Data

Report No.:	18220WC40031207	Test Sample No.:	1-2-2
Start Test Date:	2024.2.29	Finish Test Date:	2024.3.13
Test Engineer:	Hayman Chen	Auditor:	Justin Feng
Temperature:	24.3℃	Relative Humidity:	57 %
Pressure:	101 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	21.11	PASS
Band38	5MHz	16QAM	37775	1RB#0	20.51	PASS
Band38	5MHz	QPSK	37775	1RB#12	21.11	PASS
Band38	5MHz	16QAM	37775	1RB#12	20.37	PASS
Band38	5MHz	QPSK	37775	1RB#24	20.96	PASS
Band38	5MHz	16QAM	37775	1RB#24	20.20	PASS
Band38	5MHz	QPSK	37775	12RB#0	20.23	PASS
Band38	5MHz	16QAM	37775	12RB#0	19.17	PASS
Band38	5MHz	QPSK	37775	12RB#6	20.23	PASS
Band38	5MHz	16QAM	37775	12RB#6	19.15	PASS
Band38	5MHz	QPSK	37775	12RB#13	20.25	PASS
Band38	5MHz	16QAM	37775	12RB#13	19.15	PASS
Band38	5MHz	QPSK	37775	25RB#0	20.32	PASS
Band38	5MHz	16QAM	37775	25RB#0	19.18	PASS
Band38	5MHz	QPSK	38000	1RB#0	20.95	PASS
Band38	5MHz	16QAM	38000	1RB#0	20.44	PASS
Band38	5MHz	QPSK	38000	1RB#12	21.05	PASS
Band38	5MHz	16QAM	38000	1RB#12	20.44	PASS
Band38	5MHz	QPSK	38000	1RB#24	20.79	PASS
Band38	5MHz	16QAM	38000	1RB#24	20.26	PASS
Band38	5MHz	QPSK	38000	12RB#0	20.14	PASS
Band38	5MHz	16QAM	38000	12RB#0	19.03	PASS
Band38	5MHz	QPSK	38000	12RB#6	20.15	PASS
Band38	5MHz	16QAM	38000	12RB#6	19.03	PASS
Band38	5MHz	QPSK	38000	12RB#13	20.09	PASS
Band38	5MHz	16QAM	38000	12RB#13	19.02	PASS



Band38	5MHz	QPSK	38000	25RB#0	20.19	PASS
Band38	5MHz	16QAM	38000	25RB#0	19.08	PASS
Band38	5MHz	QPSK	38225	1RB#0	21.00	PASS
Band38	5MHz	16QAM	38225	1RB#0	20.56	PASS
Band38	5MHz	QPSK	38225	1RB#12	21.23	PASS
Band38	5MHz	16QAM	38225	1RB#12	20.55	PASS
Band38	5MHz	QPSK	38225	1RB#24	21.21	PASS
Band38	5MHz	16QAM	38225	1RB#24	20.56	PASS
Band38	5MHz	QPSK	38225	12RB#0	20.08	PASS
Band38	5MHz	16QAM	38225	12RB#0	19.03	PASS
Band38	5MHz	QPSK	38225	12RB#6	20.10	PASS
Band38	5MHz	16QAM	38225	12RB#6	19.00	PASS
Band38	5MHz	QPSK	38225	12RB#13	20.12	PASS
Band38	5MHz	16QAM	38225	12RB#13	18.97	PASS
Band38	5MHz	QPSK	38225	25RB#0	20.12	PASS
Band38	5MHz	16QAM	38225	25RB#0	19.14	PASS
Band38	10MHz	QPSK	37800	1RB#0	21.05	PASS
Band38	10MHz	16QAM	37800	1RB#0	20.39	PASS
Band38	10MHz	QPSK	37800	1RB#24	21.21	PASS
Band38	10MHz	16QAM	37800	1RB#24	20.21	PASS
Band38	10MHz	QPSK	37800	1RB#49	21.20	PASS
Band38	10MHz	16QAM	37800	1RB#49	20.48	PASS
Band38	10MHz	QPSK	37800	25RB#0	20.32	PASS
Band38	10MHz	16QAM	37800	25RB#0	19.26	PASS
Band38	10MHz	QPSK	37800	25RB#12	20.28	PASS
Band38	10MHz	16QAM	37800	25RB#12	19.21	PASS
Band38	10MHz	QPSK	37800	25RB#25	20.44	PASS
Band38	10MHz	16QAM	37800	25RB#25	19.36	PASS
Band38	10MHz	QPSK	37800	50RB#0	20.25	PASS
Band38	10MHz	16QAM	37800	50RB#0	19.18	PASS
Band38	10MHz	QPSK	38000	1RB#0	21.19	PASS
Band38	10MHz	16QAM	38000	1RB#0	19.85	PASS
Band38	10MHz	QPSK	38000	1RB#24	21.24	PASS
Band38	10MHz	16QAM	38000	1RB#24	20.87	PASS
Band38	10MHz	QPSK	38000	1RB#49	20.98	PASS
Band38	10MHz	16QAM	38000	1RB#49	20.51	PASS
Band38	10MHz	QPSK	38000	25RB#0	20.22	PASS
Band38	10MHz	16QAM	38000	25RB#0	19.21	PASS
Band38	10MHz	QPSK	38000	25RB#12	20.25	PASS
Band38	10MHz	16QAM	38000	25RB#12	19.22	PASS
Band38	10MHz	QPSK	38000	25RB#25	20.18	PASS
Band38	10MHz	16QAM	38000	25RB#25	19.14	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	10MHz	QPSK	38000	50RB#0	20.18	PASS
Band38	10MHz	16QAM	38000	50RB#0	19.15	PASS
Band38	10MHz	QPSK	38200	1RB#0	21.10	PASS
Band38	10MHz	16QAM	38200	1RB#0	20.77	PASS
Band38	10MHz	QPSK	38200	1RB#24	21.19	PASS
Band38	10MHz	16QAM	38200	1RB#24	20.95	PASS
Band38	10MHz	QPSK	38200	1RB#49	21.24	PASS
Band38	10MHz	16QAM	38200	1RB#49	20.44	PASS
Band38	10MHz	QPSK	38200	25RB#0	20.09	PASS
Band38	10MHz	16QAM	38200	25RB#0	18.95	PASS
Band38	10MHz	QPSK	38200	25RB#12	20.12	PASS
Band38	10MHz	16QAM	38200	25RB#12	18.96	PASS
Band38	10MHz	QPSK	38200	25RB#25	20.18	PASS
Band38	10MHz	16QAM	38200	25RB#25	19.20	PASS
Band38	10MHz	QPSK	38200	50RB#0	20.20	PASS
Band38	10MHz	16QAM	38200	50RB#0	19.08	PASS
Band38	15MHz	QPSK	37825	1RB#0	21.13	PASS
Band38	15MHz	16QAM	37825	1RB#0	20.22	PASS
Band38	15MHz	QPSK	37825	1RB#38	21.20	PASS
Band38	15MHz	16QAM	37825	1RB#38	20.40	PASS
Band38	15MHz	QPSK	37825	1RB#74	21.05	PASS
Band38	15MHz	16QAM	37825	1RB#74	20.23	PASS
Band38	15MHz	QPSK	37825	38RB#0	20.34	PASS
Band38	15MHz	16QAM	37825	38RB#0	20.45	PASS
Band38	15MHz	QPSK	37825	38RB#18	20.46	PASS
Band38	15MHz	16QAM	37825	38RB#18	20.46	PASS
Band38	15MHz	QPSK	37825	38RB#37	20.46	PASS
Band38	15MHz	16QAM	37825	38RB#37	20.46	PASS
Band38	15MHz	QPSK	37825	75RB#0	20.46	PASS
Band38	15MHz	16QAM	37825	75RB#0	19.33	PASS
Band38	15MHz	QPSK	38000	1RB#0	20.97	PASS
Band38	15MHz	16QAM	38000	1RB#0	19.98	PASS
Band38	15MHz	QPSK	38000	1RB#38	21.04	PASS
Band38	15MHz	16QAM	38000	1RB#38	19.96	PASS
Band38	15MHz	QPSK	38000	1RB#74	20.87	PASS
Band38	15MHz	16QAM	38000	1RB#74	19.82	PASS
Band38	15MHz	QPSK	38000	38RB#0	20.24	PASS
Band38	15MHz	16QAM	38000	38RB#0	20.25	PASS
Band38	15MHz	QPSK	38000	38RB#18	20.25	PASS
Band38	15MHz	16QAM	38000	38RB#18	20.24	PASS
Band38	15MHz	QPSK	38000	38RB#37	20.24	PASS
Band38	15MHz	16QAM	38000	38RB#37	20.24	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
www.anbotek.com.cn



Band38	15MHz	QPSK	38000	75RB#0	20.24	PASS
Band38	15MHz	16QAM	38000	75RB#0	19.12	PASS
Band38	15MHz	QPSK	38175	1RB#0	21.05	PASS
Band38	15MHz	16QAM	38175	1RB#0	20.27	PASS
Band38	15MHz	QPSK	38175	1RB#38	21.22	PASS
Band38	15MHz	16QAM	38175	1RB#38	20.67	PASS
Band38	15MHz	QPSK	38175	1RB#74	21.30	PASS
Band38	15MHz	16QAM	38175	1RB#74	20.79	PASS
Band38	15MHz	QPSK	38175	38RB#0	20.04	PASS
Band38	15MHz	16QAM	38175	38RB#0	20.15	PASS
Band38	15MHz	QPSK	38175	38RB#18	20.15	PASS
Band38	15MHz	16QAM	38175	38RB#18	20.15	PASS
Band38	15MHz	QPSK	38175	38RB#37	20.14	PASS
Band38	15MHz	16QAM	38175	38RB#37	20.12	PASS
Band38	15MHz	QPSK	38175	75RB#0	20.14	PASS
Band38	15MHz	16QAM	38175	75RB#0	19.13	PASS
Band38	20MHz	QPSK	37850	1RB#0	21.04	PASS
Band38	20MHz	16QAM	37850	1RB#0	20.71	PASS
Band38	20MHz	QPSK	37850	1RB#49	21.22	PASS
Band38	20MHz	16QAM	37850	1RB#49	21.36	PASS
Band38	20MHz	QPSK	37850	1RB#99	21.08	PASS
Band38	20MHz	16QAM	37850	1RB#99	20.87	PASS
Band38	20MHz	QPSK	37850	50RB#0	20.30	PASS
Band38	20MHz	16QAM	37850	50RB#0	19.31	PASS
Band38	20MHz	QPSK	37850	50RB#25	20.26	PASS
Band38	20MHz	16QAM	37850	50RB#25	19.33	PASS
Band38	20MHz	QPSK	37850	50RB#50	20.33	PASS
Band38	20MHz	16QAM	37850	50RB#50	19.29	PASS
Band38	20MHz	QPSK	37850	100RB#0	20.31	PASS
Band38	20MHz	16QAM	37850	100RB#0	19.36	PASS
Band38	20MHz	QPSK	38000	1RB#0	21.20	PASS
Band38	20MHz	16QAM	38000	1RB#0	20.41	PASS
Band38	20MHz	QPSK	38000	1RB#49	21.40	PASS
Band38	20MHz	16QAM	38000	1RB#49	20.54	PASS
Band38	20MHz	QPSK	38000	1RB#99	21.10	PASS
Band38	20MHz	16QAM	38000	1RB#99	20.29	PASS
Band38	20MHz	QPSK	38000	50RB#0	20.21	PASS
Band38	20MHz	16QAM	38000	50RB#0	19.31	PASS
Band38	20MHz	QPSK	38000	50RB#25	20.25	PASS
Band38	20MHz	16QAM	38000	50RB#25	19.27	PASS
Band38	20MHz	QPSK	38000	50RB#50	20.11	PASS
Band38	20MHz	16QAM	38000	50RB#50	19.21	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	20MHz	QPSK	38000	100RB#0	20.18	PASS
Band38	20MHz	16QAM	38000	100RB#0	19.05	PASS
Band38	20MHz	QPSK	38150	1RB#0	20.70	PASS
Band38	20MHz	16QAM	38150	1RB#0	19.98	PASS
Band38	20MHz	QPSK	38150	1RB#49	20.99	PASS
Band38	20MHz	16QAM	38150	1RB#49	20.12	PASS
Band38	20MHz	QPSK	38150	1RB#99	21.02	PASS
Band38	20MHz	16QAM	38150	1RB#99	20.10	PASS
Band38	20MHz	QPSK	38150	50RB#0	20.05	PASS
Band38	20MHz	16QAM	38150	50RB#0	19.02	PASS
Band38	20MHz	QPSK	38150	50RB#25	20.04	PASS
Band38	20MHz	16QAM	38150	50RB#25	19.03	PASS
Band38	20MHz	QPSK	38150	50RB#50	20.16	PASS
Band38	20MHz	16QAM	38150	50RB#50	19.01	PASS
Band38	20MHz	QPSK	38150	100RB#0	20.11	PASS
Band38	20MHz	16QAM	38150	100RB#0	18.94	PASS



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	8.93	13	PASS
Band38	5MHz	16QAM	37775	1RB#0	9.49	13	PASS
Band38	5MHz	QPSK	37775	25RB#0	9.02	13	PASS
Band38	5MHz	16QAM	37775	25RB#0	10.02	13	PASS
Band38	5MHz	QPSK	38000	1RB#0	9.19	13	PASS
Band38	5MHz	16QAM	38000	1RB#0	9.59	13	PASS
Band38	5MHz	QPSK	38000	25RB#0	9.79	13	PASS
Band38	5MHz	16QAM	38000	25RB#0	10.14	13	PASS
Band38	5MHz	QPSK	38225	1RB#0	9.41	13	PASS
Band38	5MHz	16QAM	38225	1RB#0	9.95	13	PASS
Band38	5MHz	QPSK	38225	25RB#0	9.39	13	PASS
Band38	5MHz	16QAM	38225	25RB#0	10.04	13	PASS
Band38	10MHz	QPSK	37800	1RB#0	8.96	13	PASS
Band38	10MHz	16QAM	37800	1RB#0	10.03	13	PASS
Band38	10MHz	QPSK	37800	50RB#0	9.42	13	PASS
Band38	10MHz	16QAM	37800	50RB#0	10.20	13	PASS
Band38	10MHz	QPSK	38000	1RB#0	9.41	13	PASS
Band38	10MHz	16QAM	38000	1RB#0	9.91	13	PASS
Band38	10MHz	QPSK	38000	50RB#0	9.55	13	PASS
Band38	10MHz	16QAM	38000	50RB#0	10.44	13	PASS
Band38	10MHz	QPSK	38200	1RB#0	9.46	13	PASS
Band38	10MHz	16QAM	38200	1RB#0	9.71	13	PASS
Band38	10MHz	QPSK	38200	50RB#0	9.49	13	PASS
Band38	10MHz	16QAM	38200	50RB#0	10.34	13	PASS
Band38	15MHz	QPSK	37825	1RB#0	9.01	13	PASS
Band38	15MHz	16QAM	37825	1RB#0	9.76	13	PASS
Band38	15MHz	QPSK	37825	75RB#0	9.65	13	PASS
Band38	15MHz	16QAM	37825	75RB#0	9.96	13	PASS
Band38	15MHz	QPSK	38000	1RB#0	9.11	13	PASS
Band38	15MHz	16QAM	38000	1RB#0	9.93	13	PASS
Band38	15MHz	QPSK	38000	75RB#0	9.64	13	PASS
Band38	15MHz	16QAM	38000	75RB#0	10.17	13	PASS
Band38	15MHz	QPSK	38175	1RB#0	9.81	13	PASS
Band38	15MHz	16QAM	38175	1RB#0	10.21	13	PASS
Band38	15MHz	QPSK	38175	75RB#0	9.45	13	PASS
Band38	15MHz	16QAM	38175	75RB#0	10.40	13	PASS
Band38	20MHz	QPSK	37850	1RB#0	9.28	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	20MHz	16QAM	37850	1RB#0	10.02	13	PASS
Band38	20MHz	QPSK	37850	100RB#0	9.13	13	PASS
Band38	20MHz	16QAM	37850	100RB#0	10.41	13	PASS
Band38	20MHz	QPSK	38000	1RB#0	8.80	13	PASS
Band38	20MHz	16QAM	38000	1RB#0	9.77	13	PASS
Band38	20MHz	QPSK	38000	100RB#0	8.97	13	PASS
Band38	20MHz	16QAM	38000	100RB#0	9.71	13	PASS
Band38	20MHz	QPSK	38150	1RB#0	9.30	13	PASS
Band38	20MHz	16QAM	38150	1RB#0	9.72	13	PASS
Band38	20MHz	QPSK	38150	100RB#0	9.54	13	PASS
Band38	20MHz	16QAM	38150	100RB#0	9.89	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Test Graphs

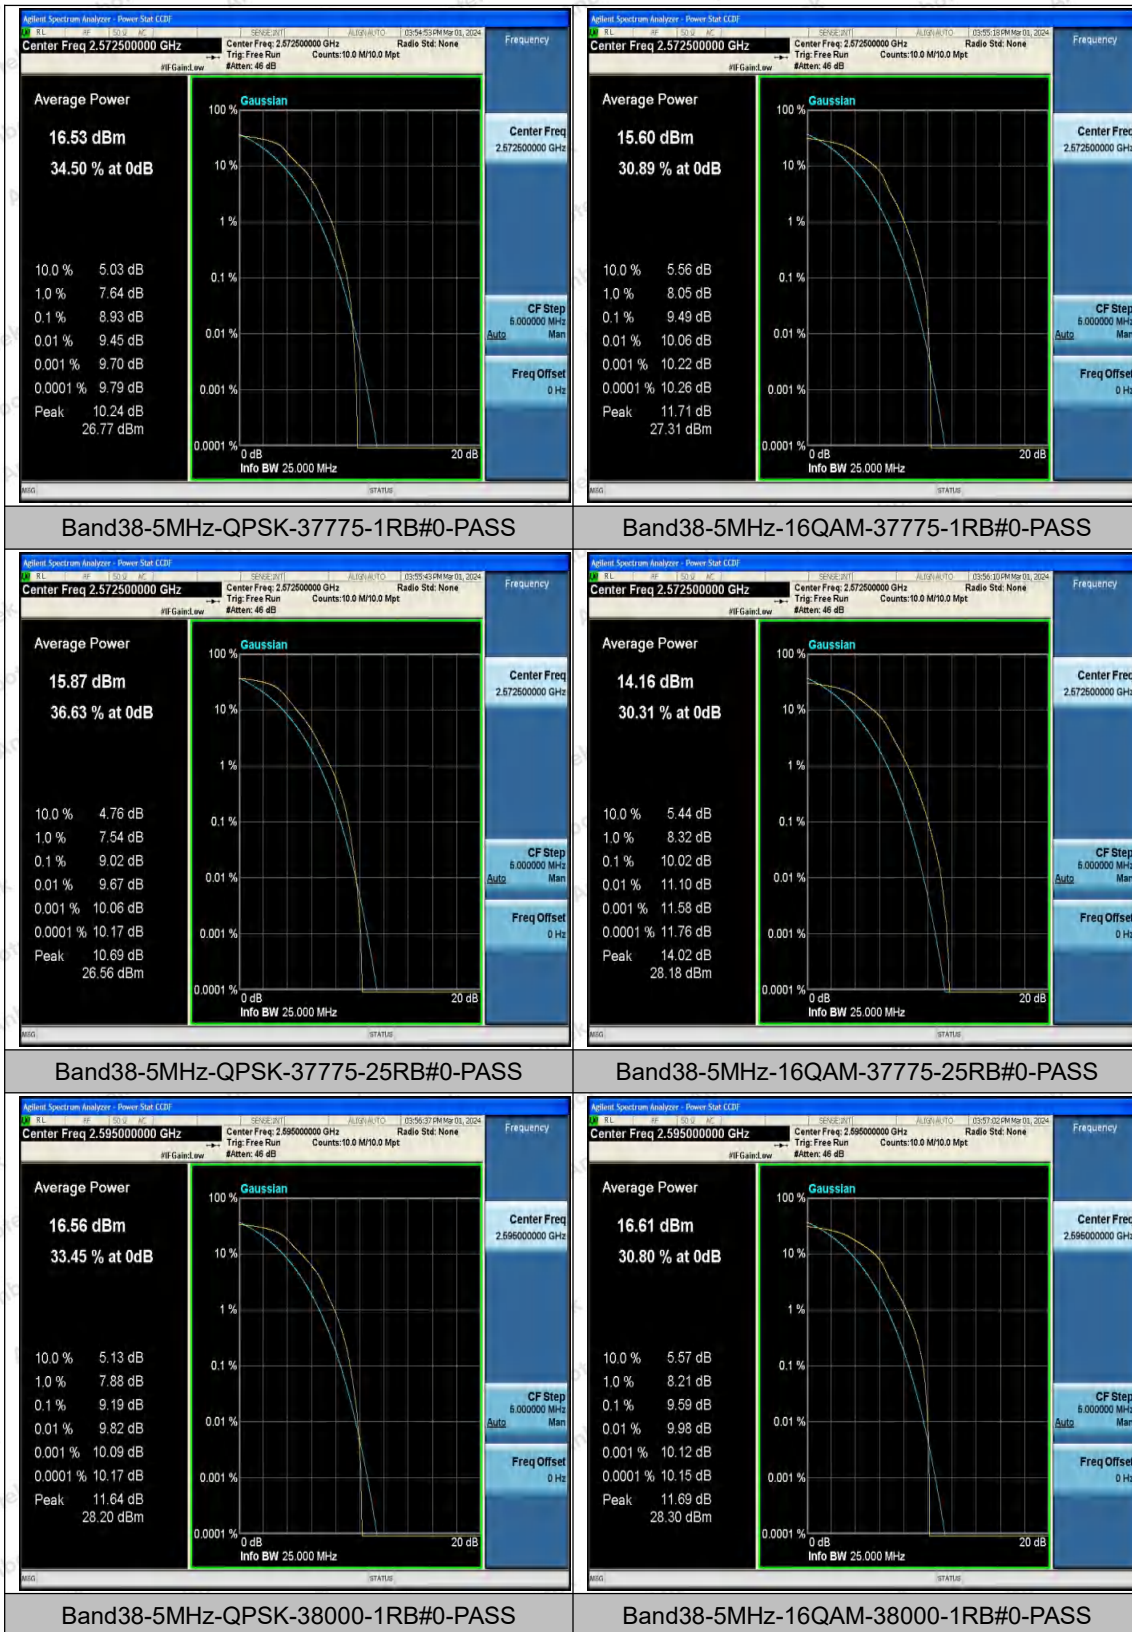


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com





Hotline
400-003-0500
www.anbotek.com.cn




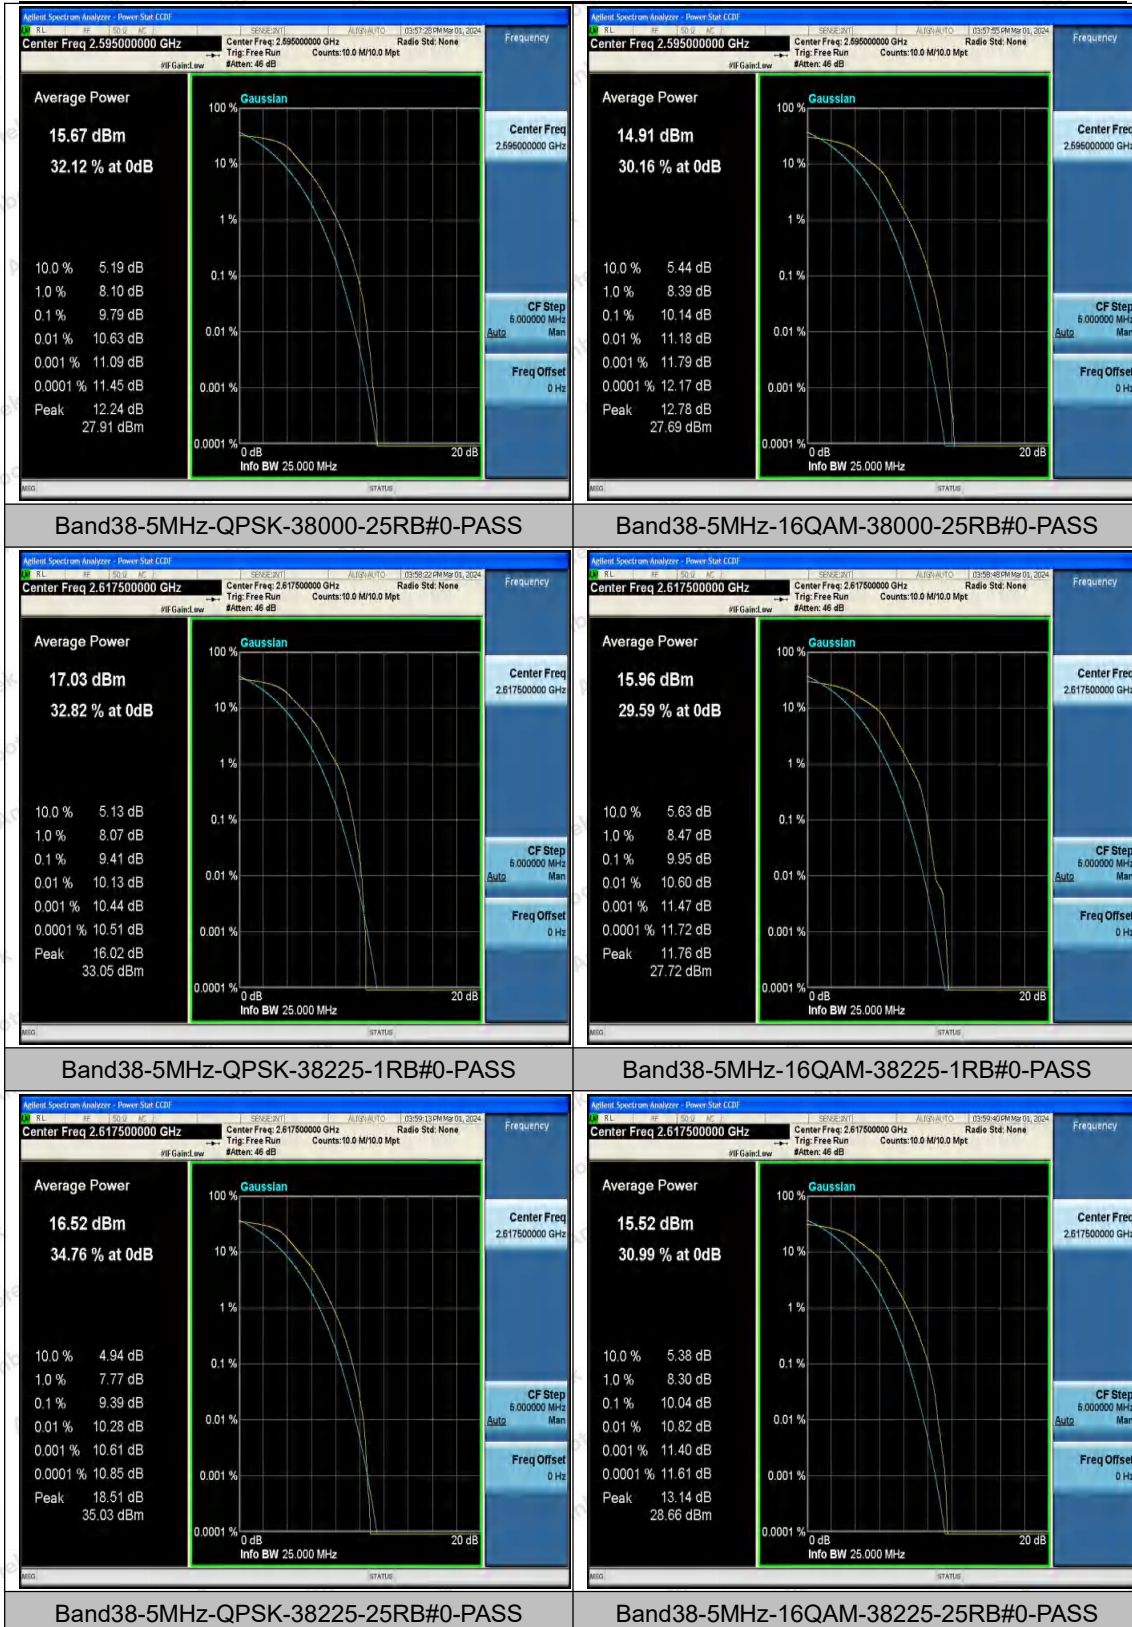


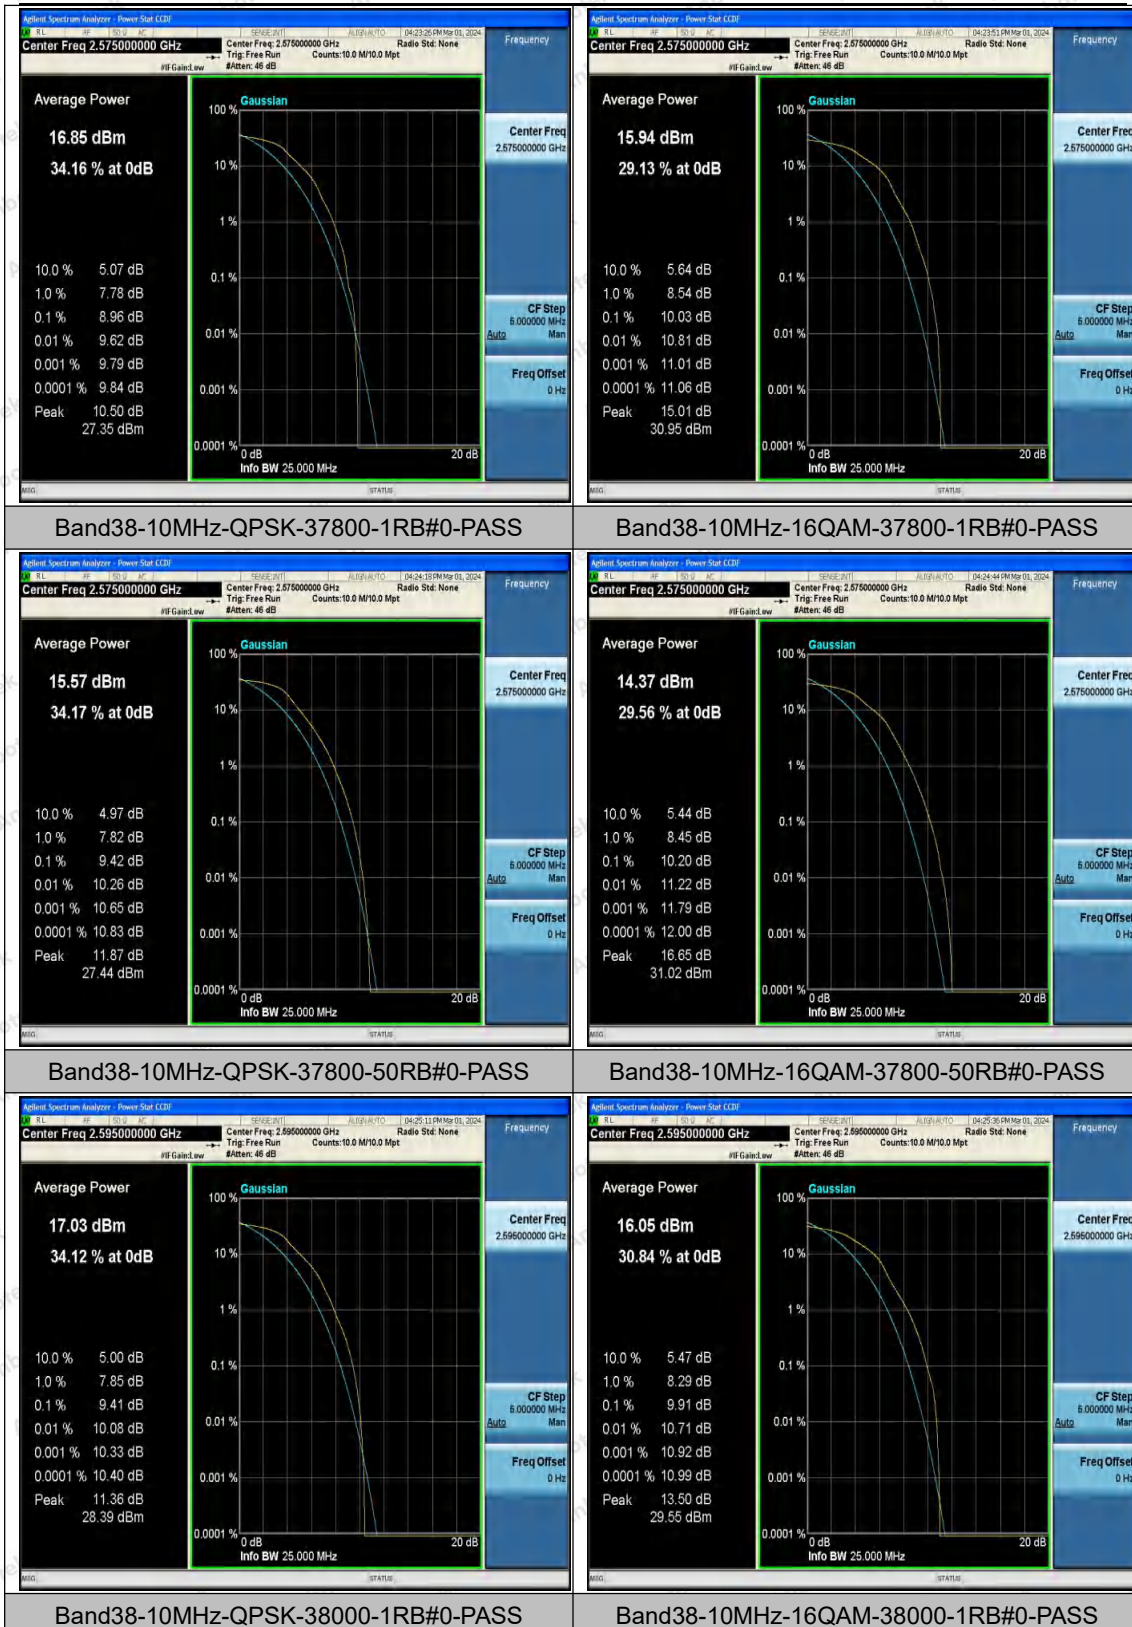


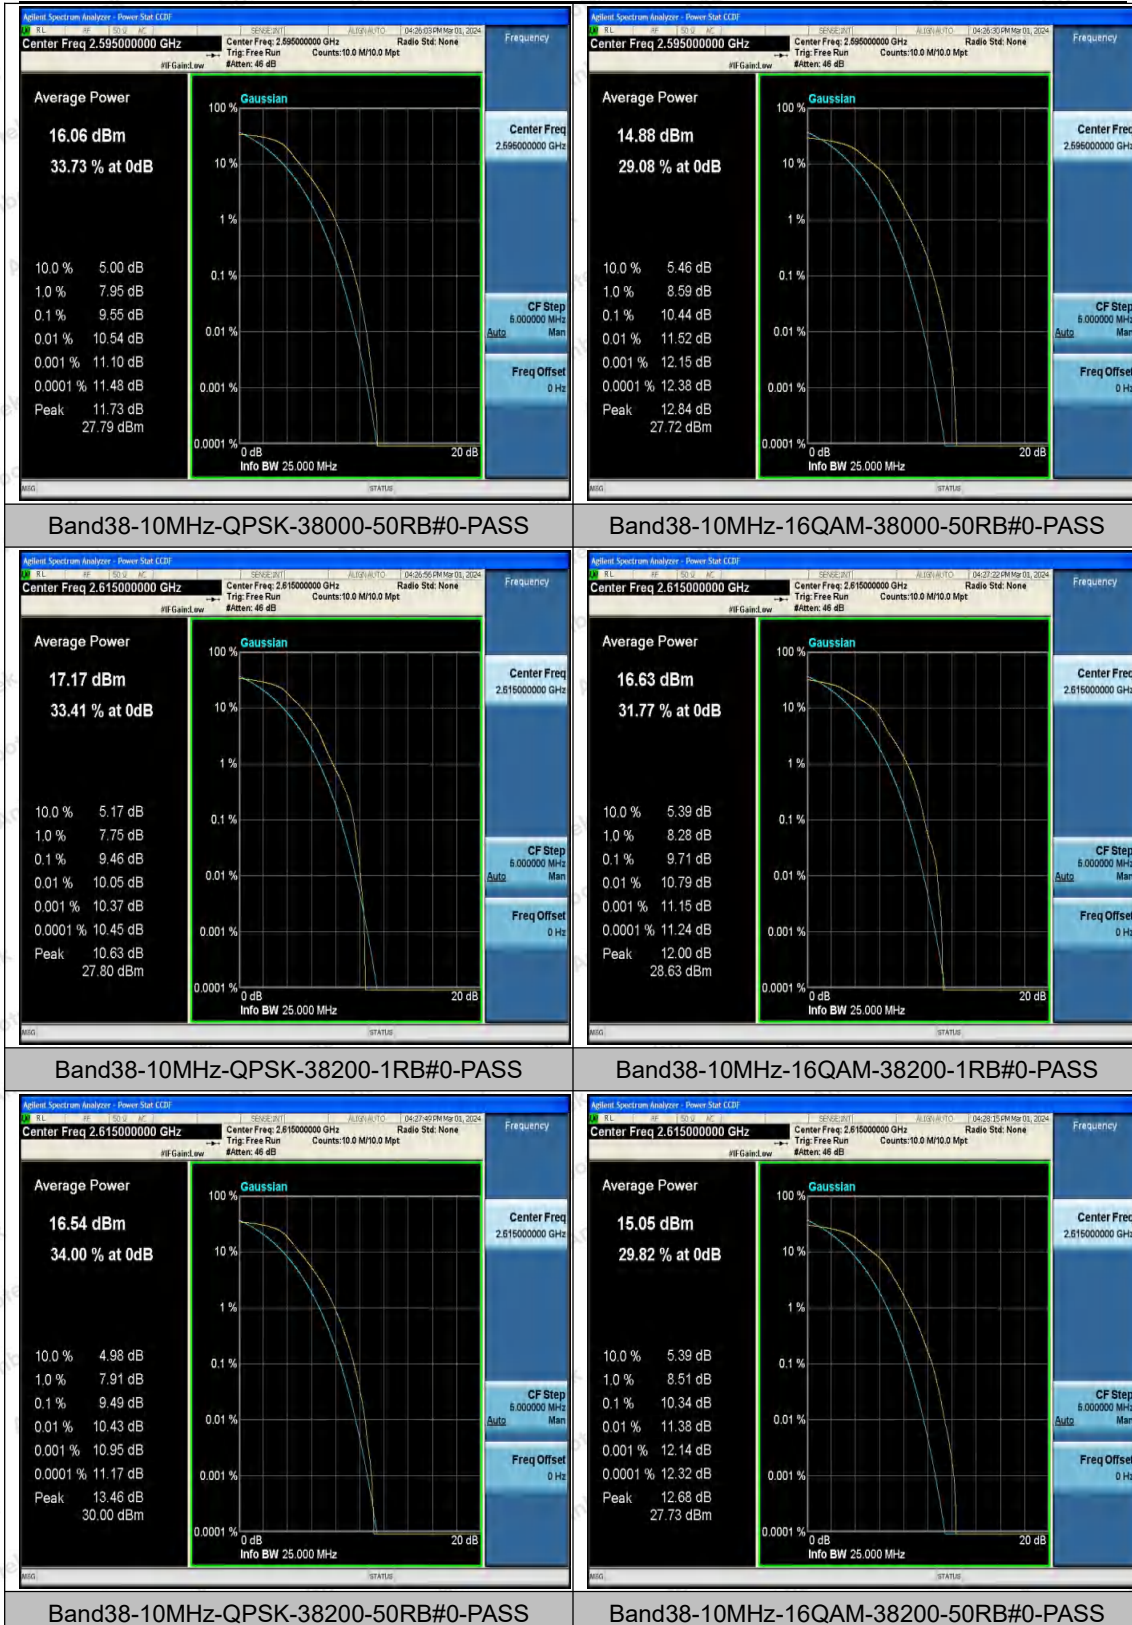

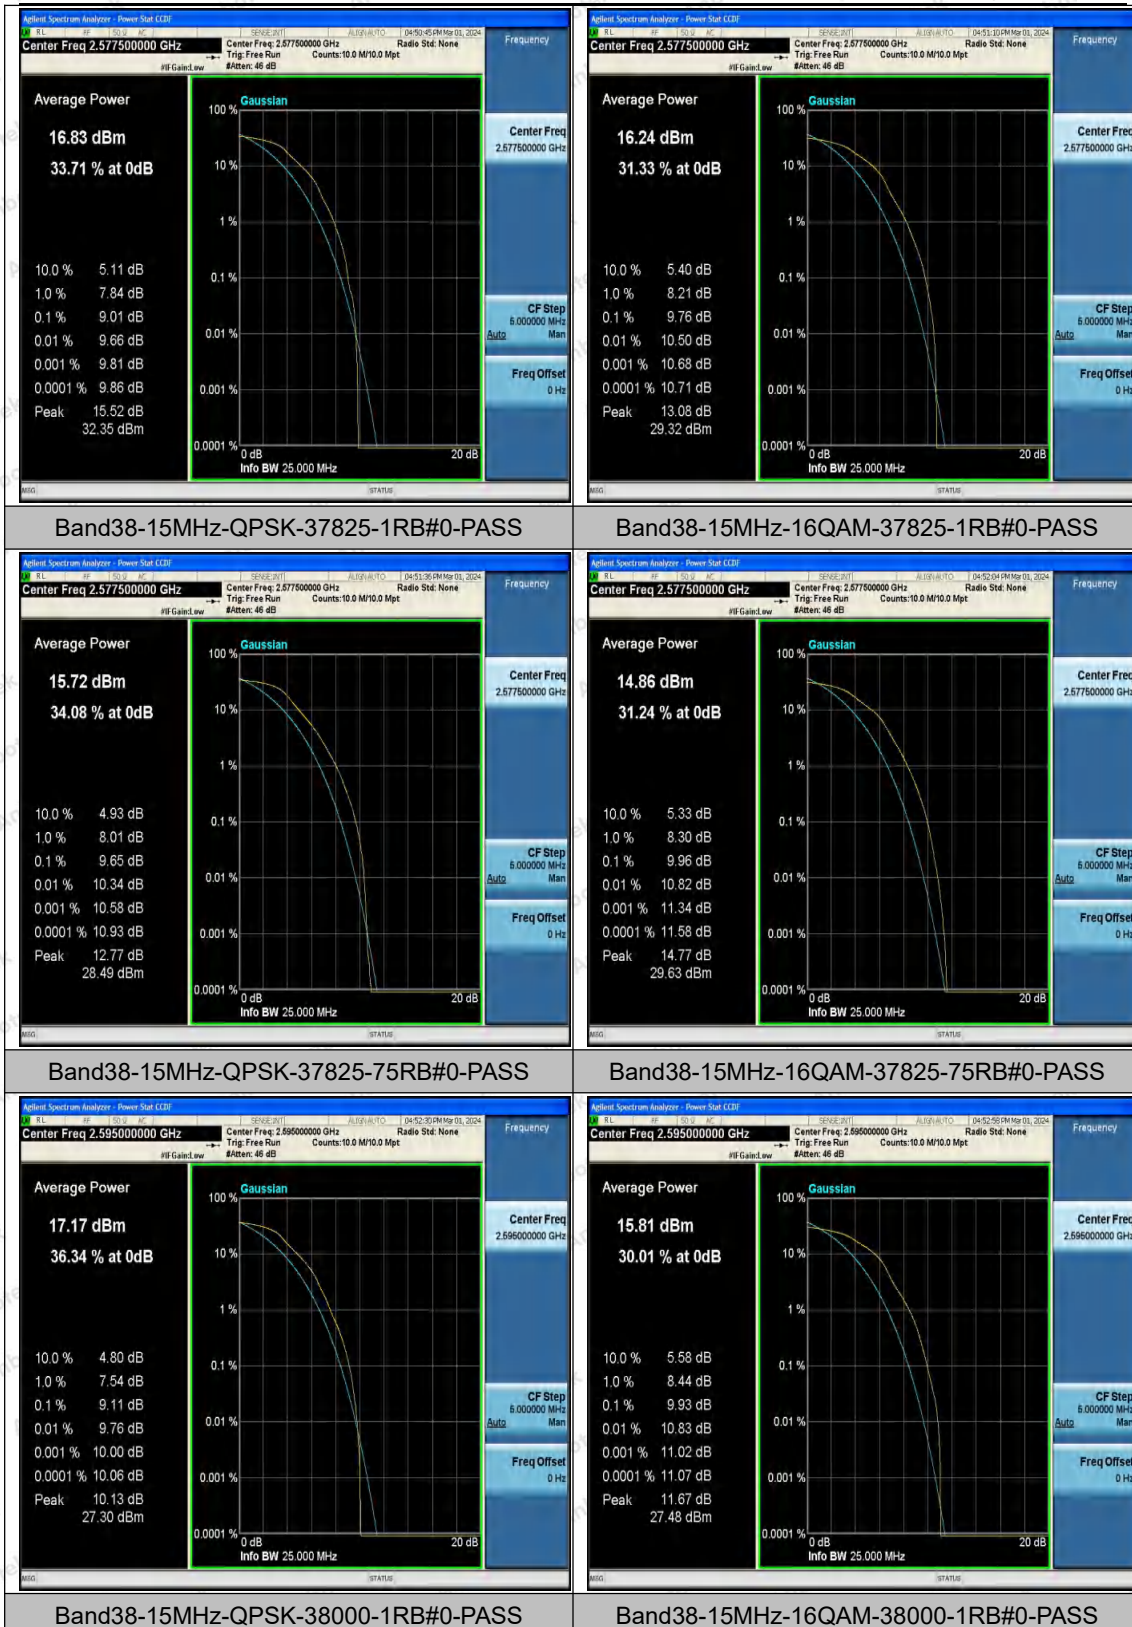

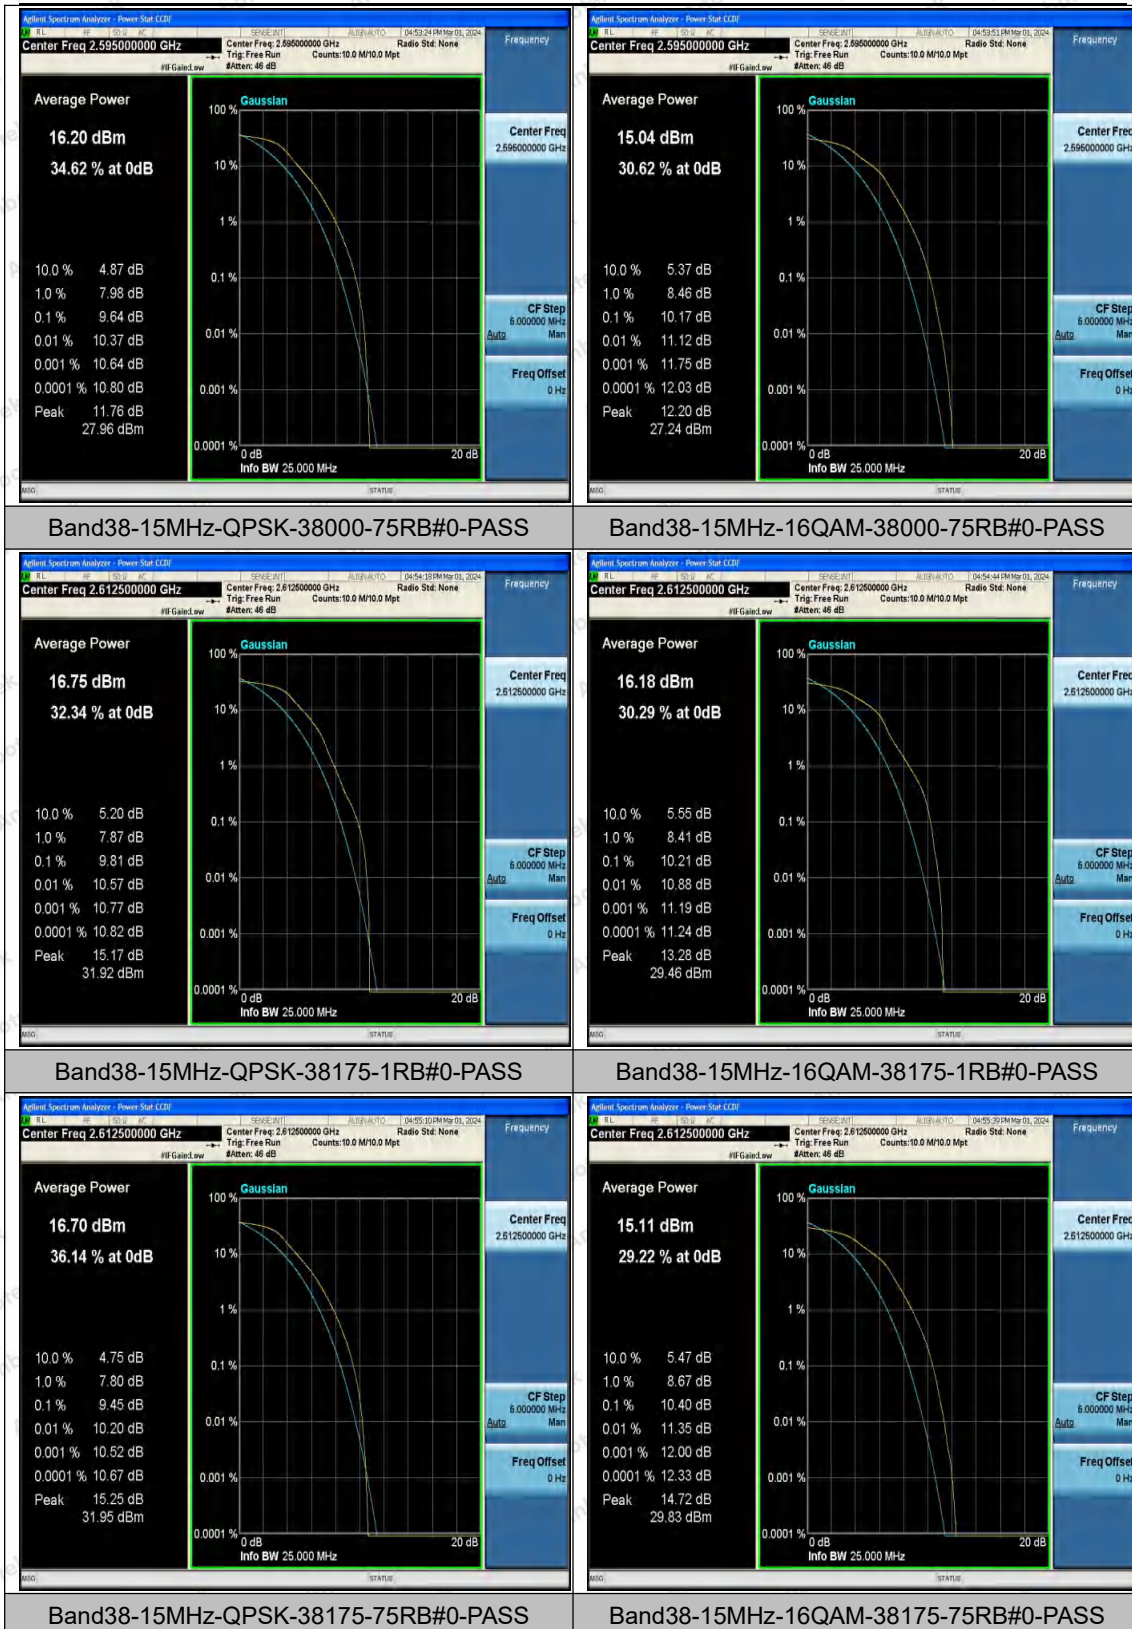

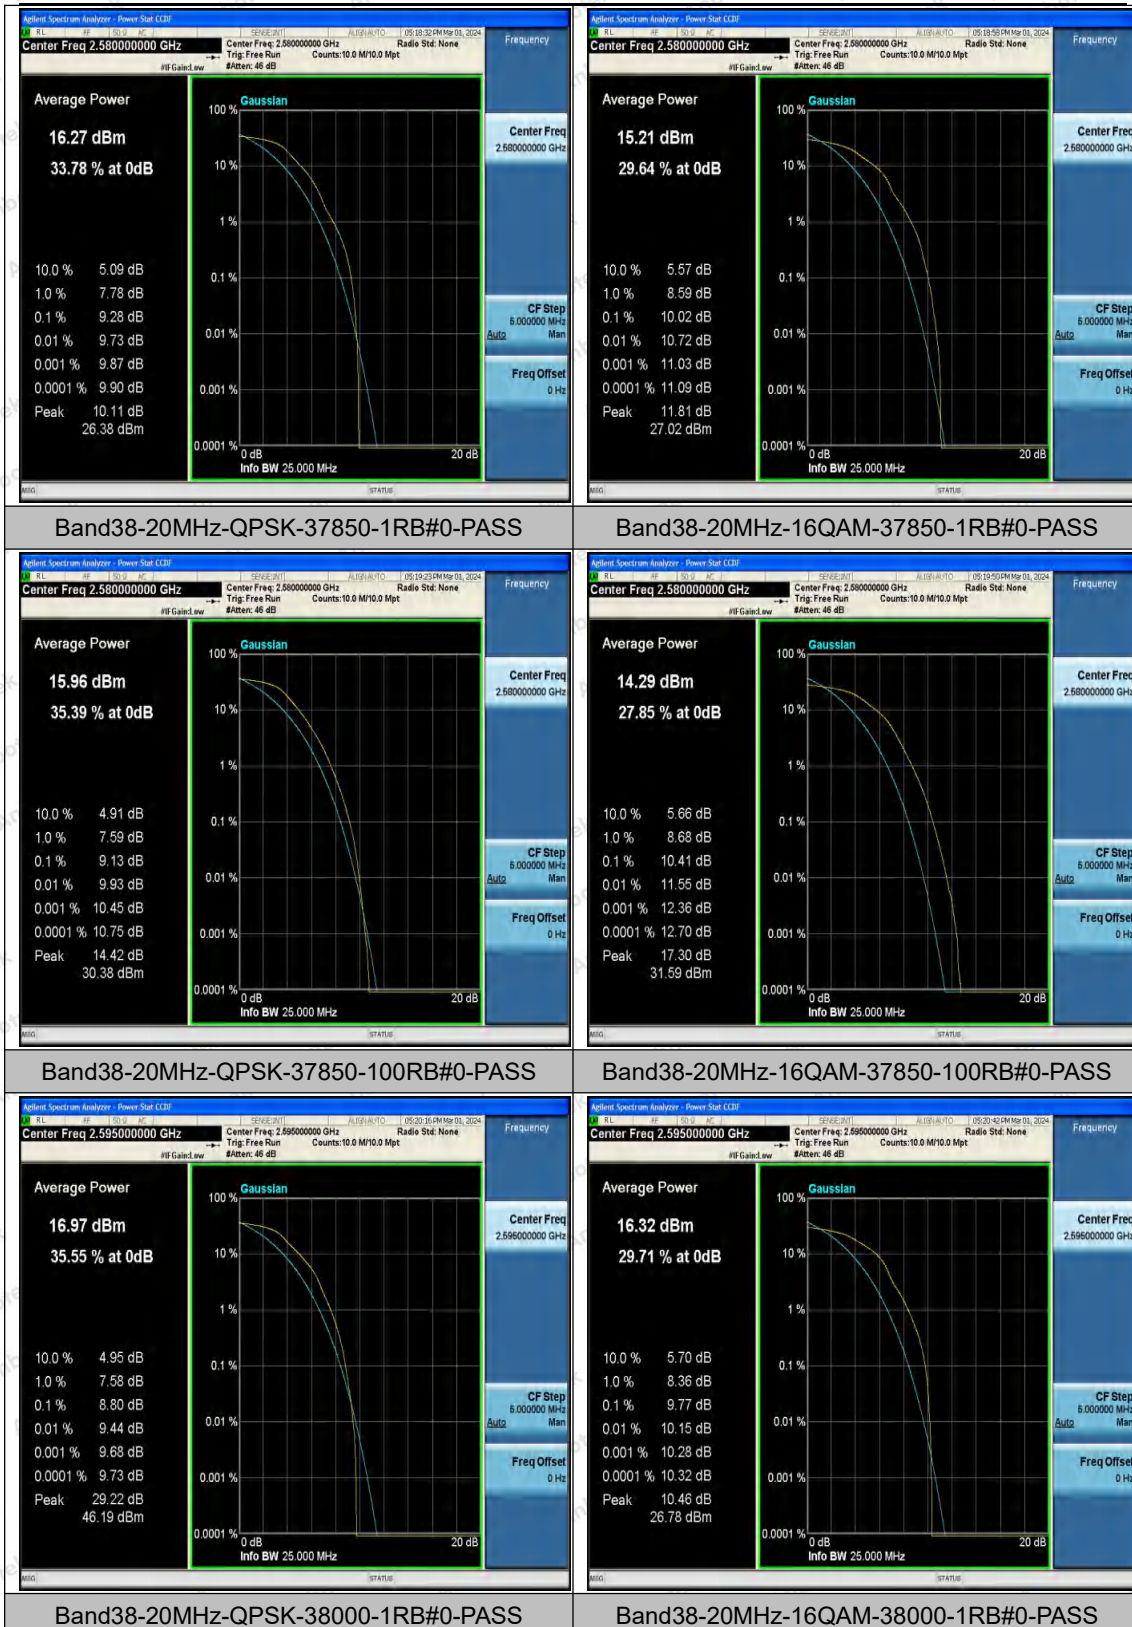

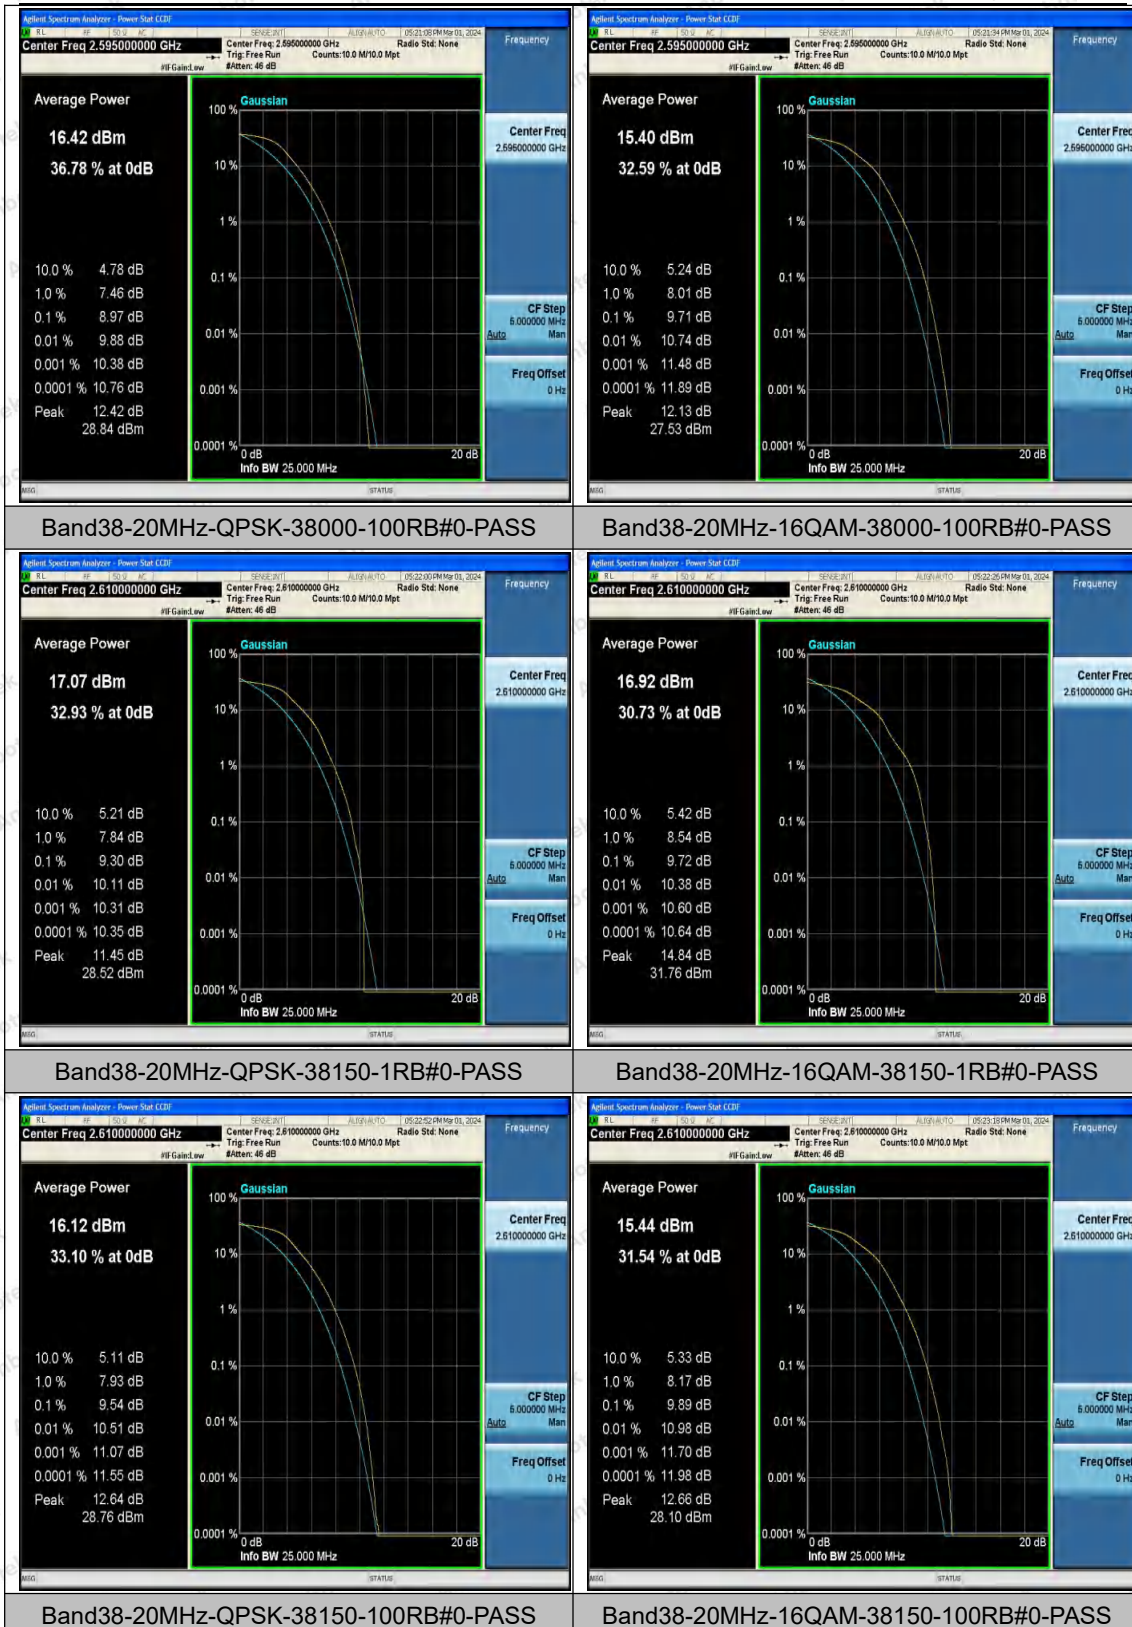


Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band38	5MHz	QPSK	37775	25RB#0	4.4952	4.947	PASS
Band38	5MHz	16QAM	37775	25RB#0	4.4881	4.966	PASS
Band38	5MHz	QPSK	38000	25RB#0	4.4962	5.015	PASS
Band38	5MHz	16QAM	38000	25RB#0	4.4925	4.984	PASS
Band38	5MHz	QPSK	38225	25RB#0	4.4914	4.974	PASS
Band38	5MHz	16QAM	38225	25RB#0	4.4934	5.052	PASS
Band38	10MHz	QPSK	37800	50RB#0	9.0065	9.850	PASS
Band38	10MHz	16QAM	37800	50RB#0	8.9632	9.815	PASS
Band38	10MHz	QPSK	38000	50RB#0	8.9702	9.781	PASS
Band38	10MHz	16QAM	38000	50RB#0	8.9852	9.780	PASS
Band38	10MHz	QPSK	38200	50RB#0	8.9632	9.900	PASS
Band38	10MHz	16QAM	38200	50RB#0	8.9448	9.839	PASS
Band38	15MHz	QPSK	37825	75RB#0	13.394	14.91	PASS
Band38	15MHz	16QAM	37825	75RB#0	13.501	15.36	PASS
Band38	15MHz	QPSK	38000	75RB#0	13.414	14.74	PASS
Band38	15MHz	16QAM	38000	75RB#0	13.419	14.74	PASS
Band38	15MHz	QPSK	38175	75RB#0	13.451	14.59	PASS
Band38	15MHz	16QAM	38175	75RB#0	13.372	14.85	PASS
Band38	20MHz	QPSK	37850	100RB#0	17.935	19.43	PASS
Band38	20MHz	16QAM	37850	100RB#0	17.873	19.37	PASS
Band38	20MHz	QPSK	38000	100RB#0	17.908	19.34	PASS
Band38	20MHz	16QAM	38000	100RB#0	17.887	20.27	PASS
Band38	20MHz	QPSK	38150	100RB#0	17.878	19.57	PASS
Band38	20MHz	16QAM	38150	100RB#0	17.890	19.47	PASS



Test Graphs

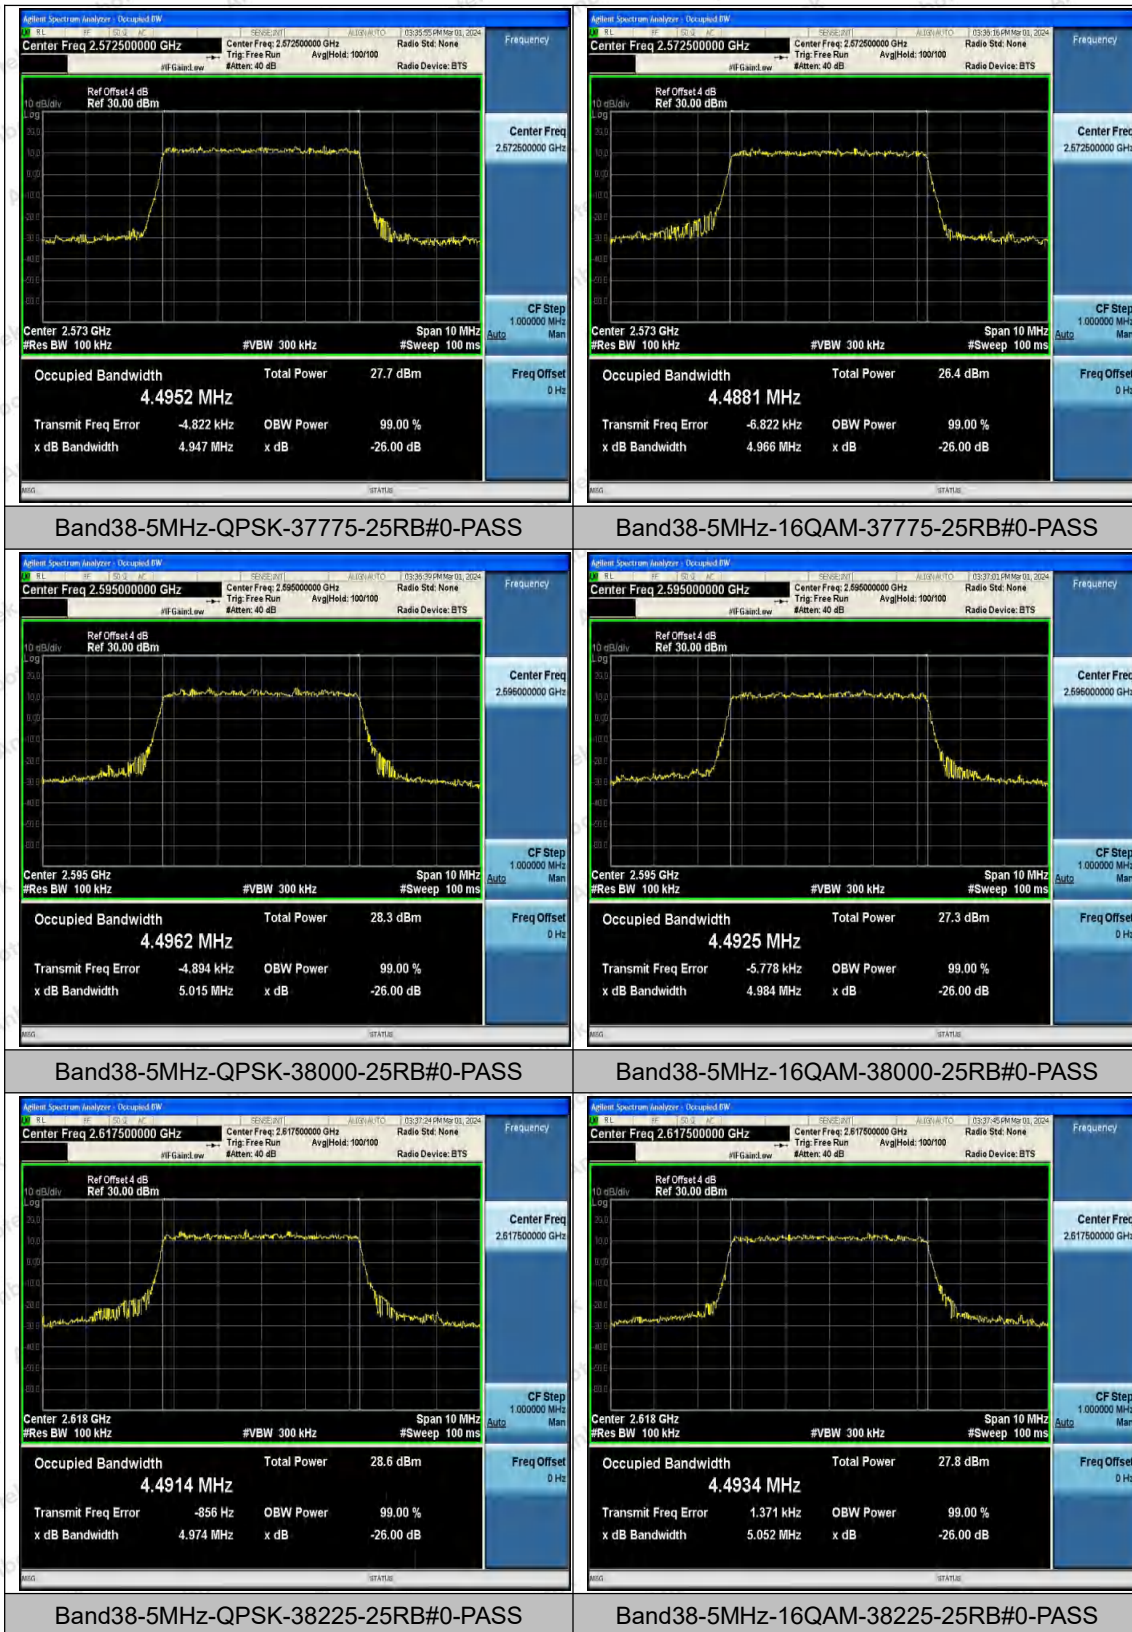


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



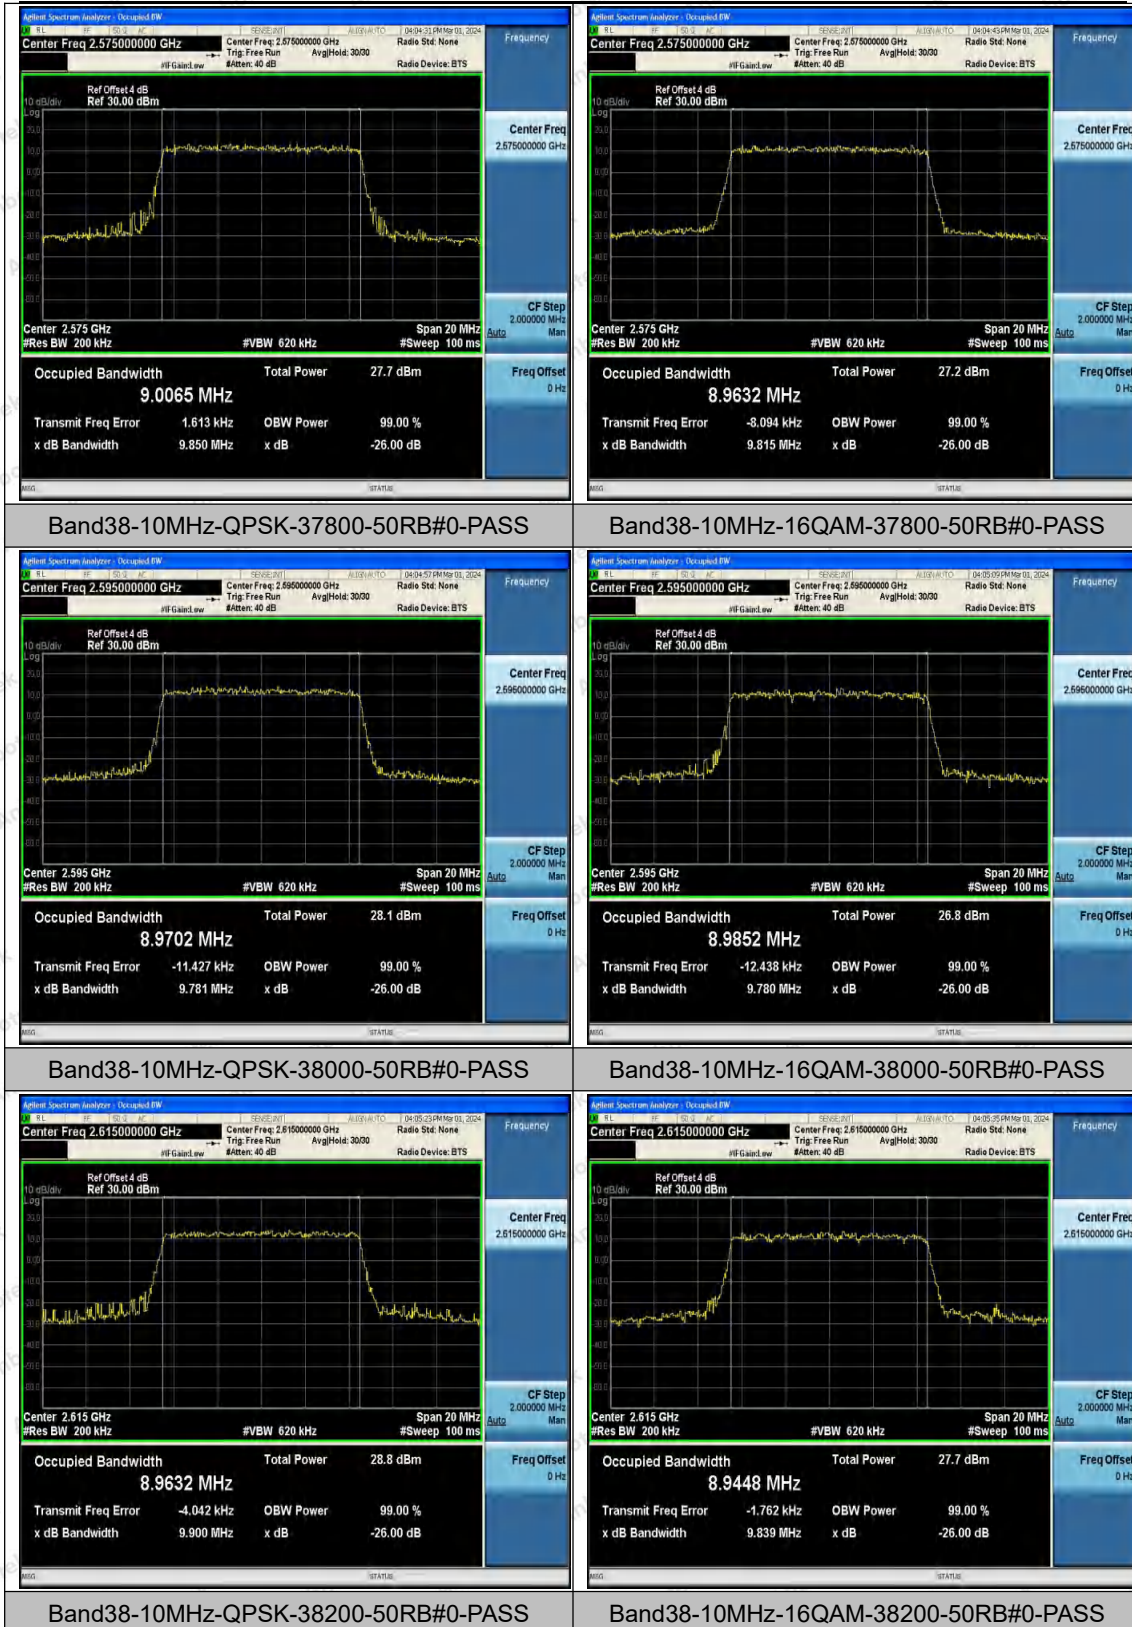

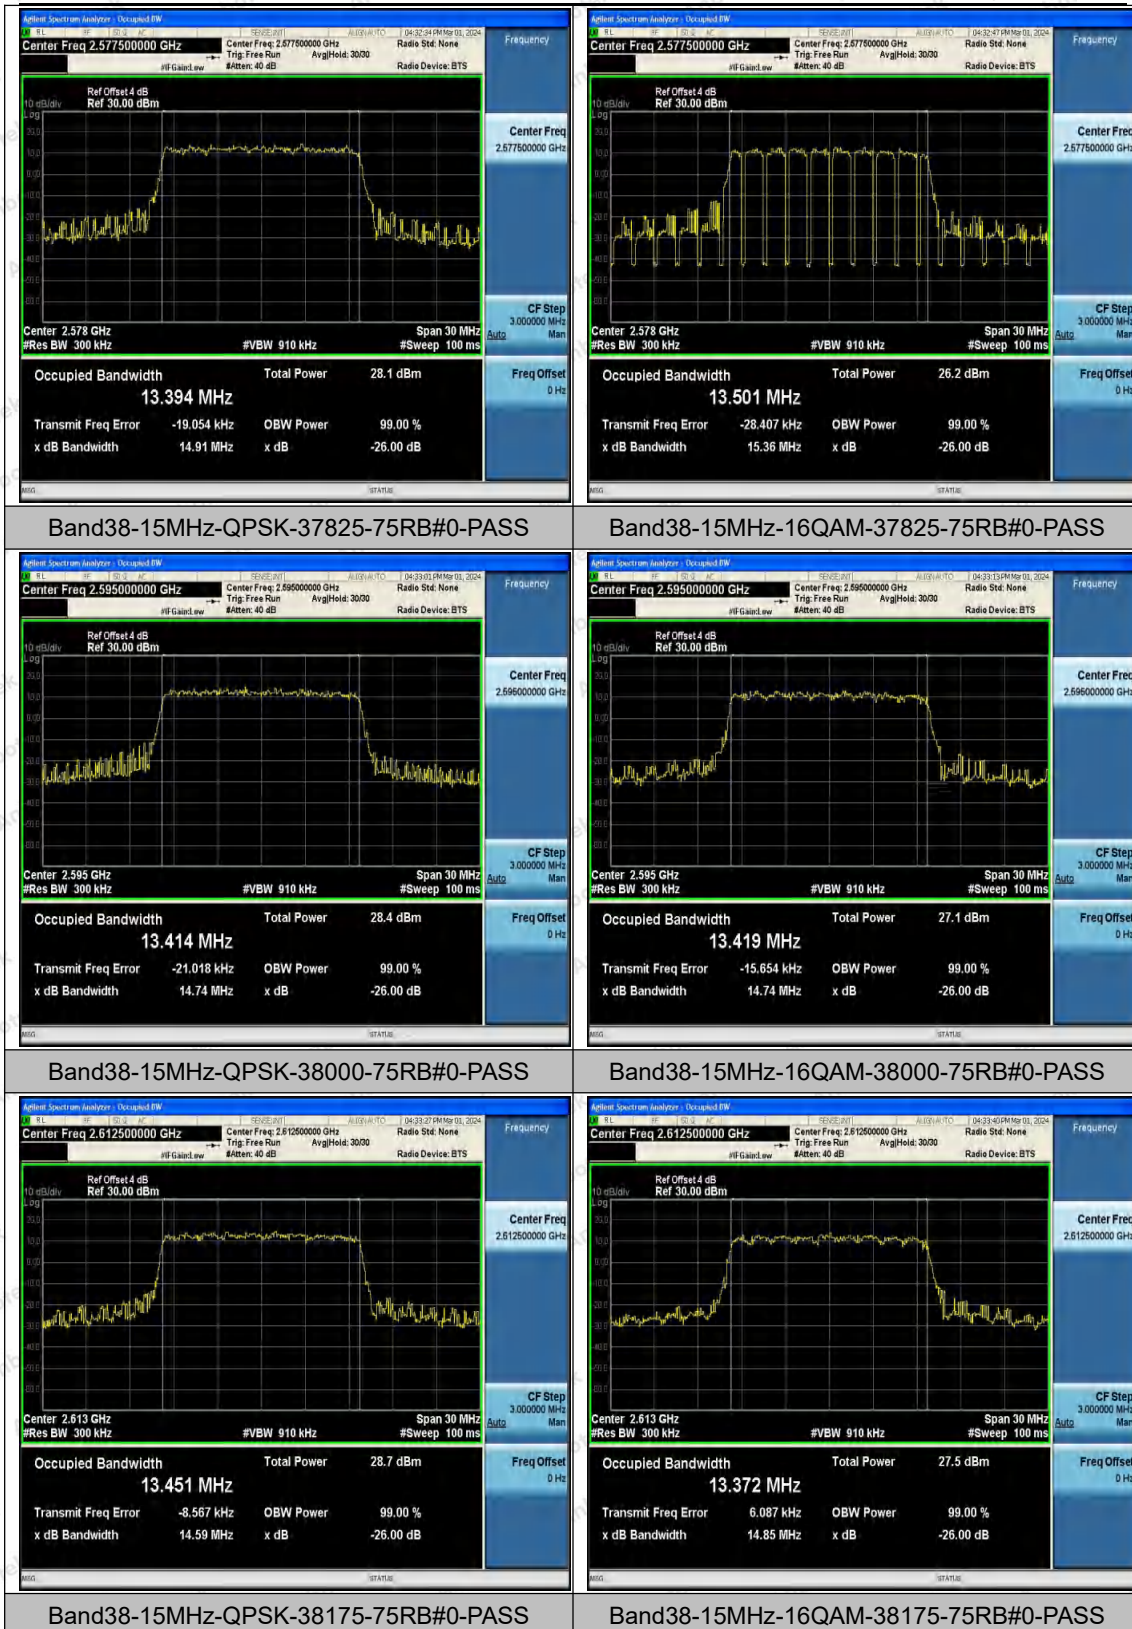



Appendix D: Band Edge


Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	-21.38	PASS
Band38	5MHz	16QAM	37775	1RB#0	-19.60	PASS
Band38	5MHz	QPSK	37775	1RB#24	-35.81	PASS
Band38	5MHz	16QAM	37775	1RB#24	-55.34	PASS
Band38	5MHz	QPSK	37775	25RB#0	-43.12	PASS
Band38	5MHz	16QAM	37775	25RB#0	-43.95	PASS
Band38	5MHz	QPSK	38225	1RB#0	-30.53	PASS
Band38	5MHz	16QAM	38225	1RB#0	-35.04	PASS
Band38	5MHz	QPSK	38225	1RB#24	-19.47	PASS
Band38	5MHz	16QAM	38225	1RB#24	-20.09	PASS
Band38	5MHz	QPSK	38225	25RB#0	-41.78	PASS
Band38	5MHz	16QAM	38225	25RB#0	-43.26	PASS
Band38	10MHz	QPSK	37800	1RB#0	-26.91	PASS
Band38	10MHz	16QAM	37800	1RB#0	-27.25	PASS
Band38	10MHz	QPSK	37800	1RB#49	-28.74	PASS
Band38	10MHz	16QAM	37800	1RB#49	-32.11	PASS
Band38	10MHz	QPSK	37800	50RB#0	-42.57	PASS
Band38	10MHz	16QAM	37800	50RB#0	-43.13	PASS
Band38	10MHz	QPSK	38200	1RB#0	-32.62	PASS
Band38	10MHz	16QAM	38200	1RB#0	-36.84	PASS
Band38	10MHz	QPSK	38200	1RB#49	-23.75	PASS
Band38	10MHz	16QAM	38200	1RB#49	-23.67	PASS
Band38	10MHz	QPSK	38200	50RB#0	-41.98	PASS
Band38	10MHz	16QAM	38200	50RB#0	-42.66	PASS
Band38	15MHz	QPSK	37825	1RB#0	-25.10	PASS
Band38	15MHz	16QAM	37825	1RB#0	-25.40	PASS
Band38	15MHz	QPSK	37825	1RB#74	-26.82	PASS
Band38	15MHz	16QAM	37825	1RB#74	-30.02	PASS
Band38	15MHz	QPSK	37825	75RB#0	-40.66	PASS
Band38	15MHz	16QAM	37825	75RB#0	-41.05	PASS
Band38	15MHz	QPSK	38175	1RB#0	-31.36	PASS
Band38	15MHz	16QAM	38175	1RB#0	-33.78	PASS
Band38	15MHz	QPSK	38175	1RB#74	-24.86	PASS
Band38	15MHz	16QAM	38175	1RB#74	-27.63	PASS
Band38	15MHz	QPSK	38175	75RB#0	-40.86	PASS
Band38	15MHz	16QAM	38175	75RB#0	-41.12	PASS
Band38	20MHz	QPSK	37850	1RB#0	-26.97	PASS



Band38	20MHz	16QAM	37850	1RB#0	-29.46	PASS
Band38	20MHz	QPSK	37850	1RB#99	-31.95	PASS
Band38	20MHz	16QAM	37850	1RB#99	-32.56	PASS
Band38	20MHz	QPSK	37850	100RB#0	-41.92	PASS
Band38	20MHz	16QAM	37850	100RB#0	-42.00	PASS
Band38	20MHz	QPSK	38150	1RB#0	-35.99	PASS
Band38	20MHz	16QAM	38150	1RB#0	-37.11	PASS
Band38	20MHz	QPSK	38150	1RB#99	-28.17	PASS
Band38	20MHz	16QAM	38150	1RB#99	-30.06	PASS
Band38	20MHz	QPSK	38150	100RB#0	-42.34	PASS
Band38	20MHz	16QAM	38150	100RB#0	-42.30	PASS

Test Graphs

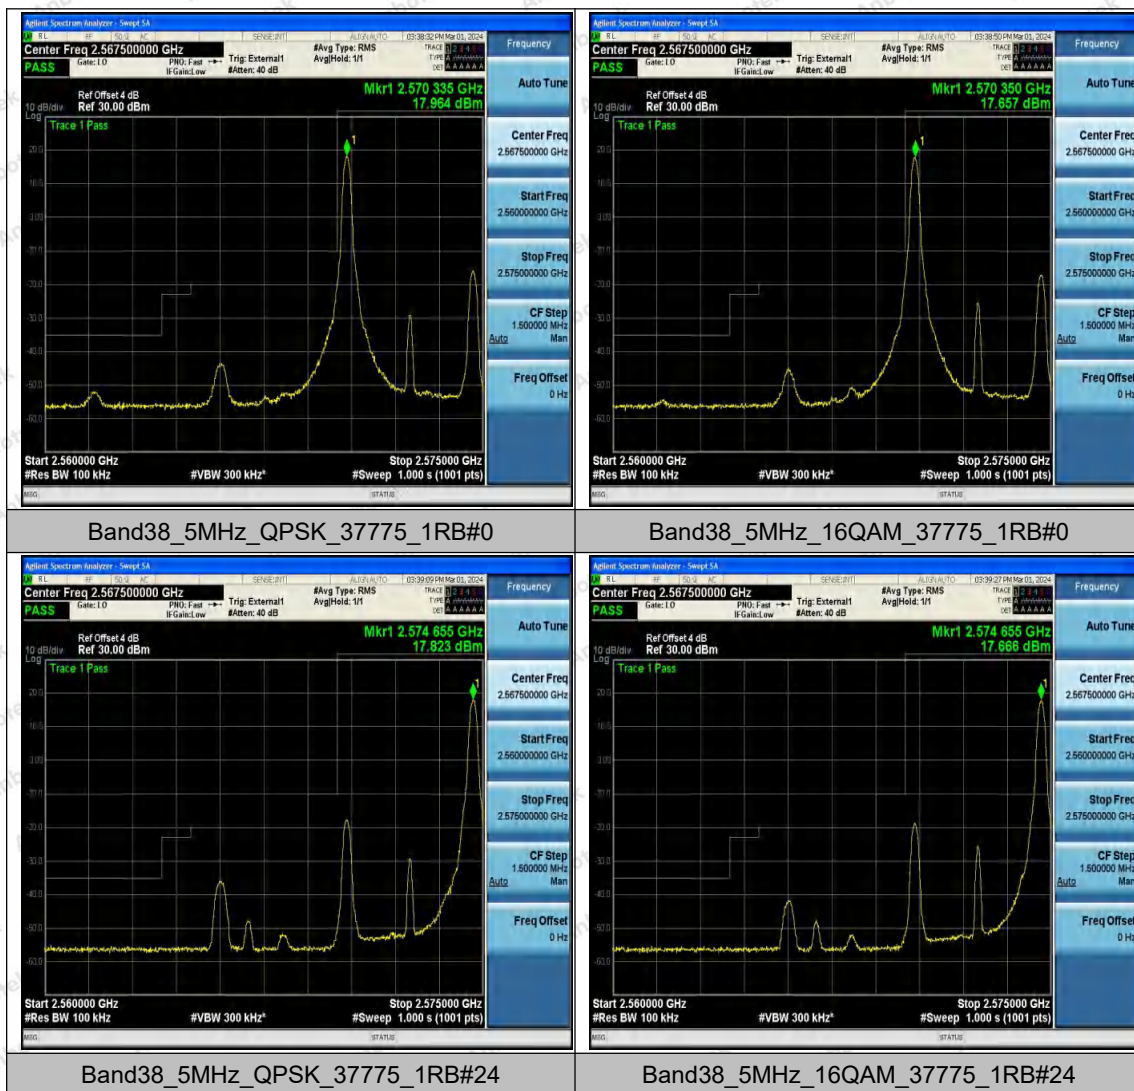


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



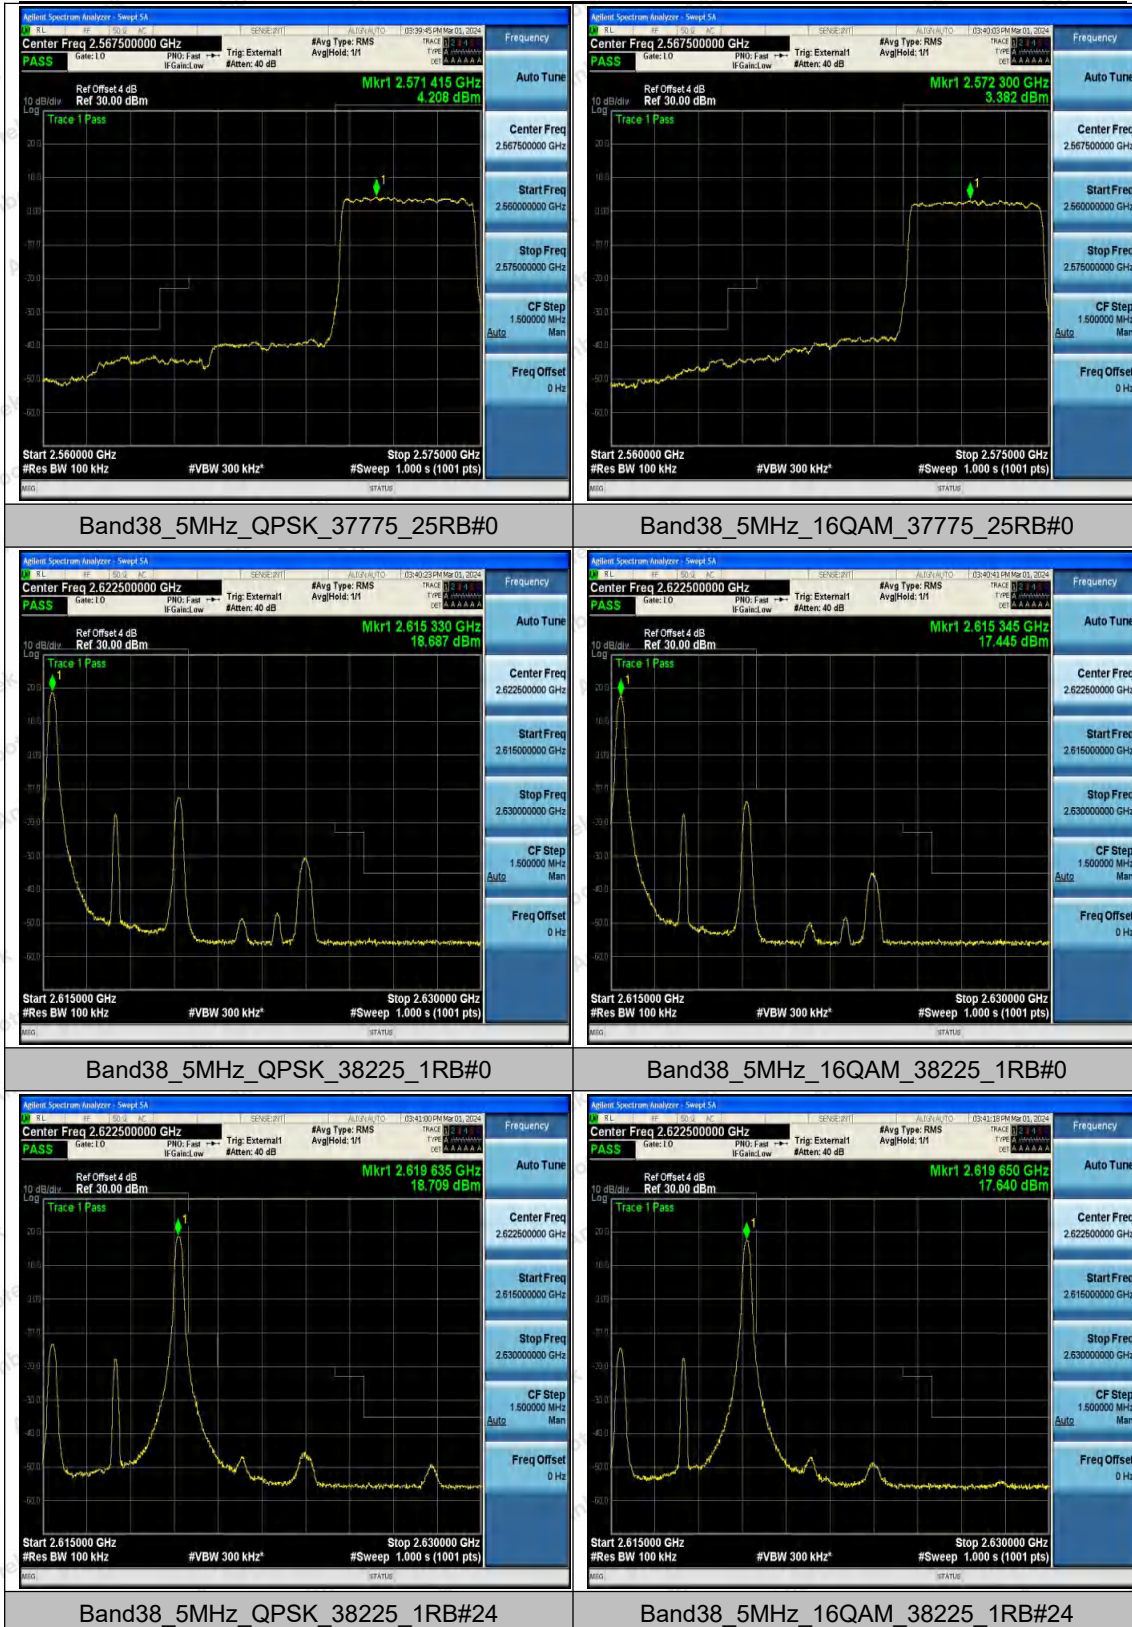

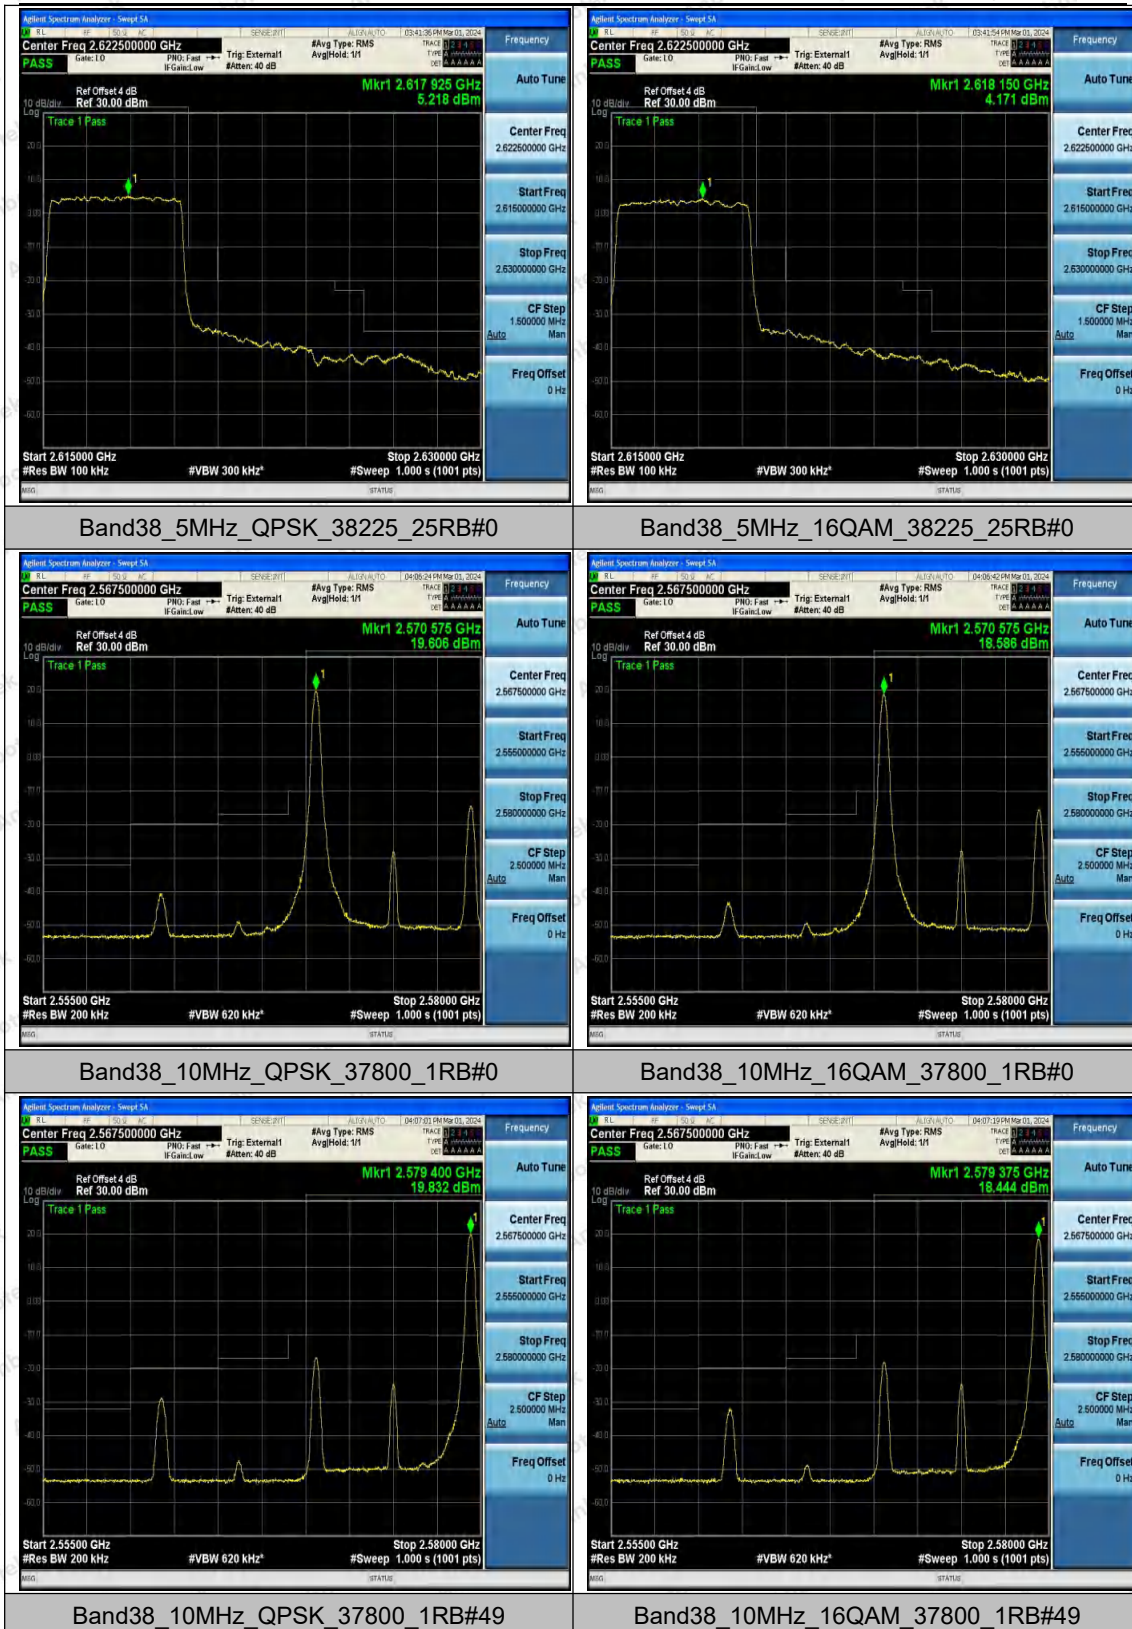


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



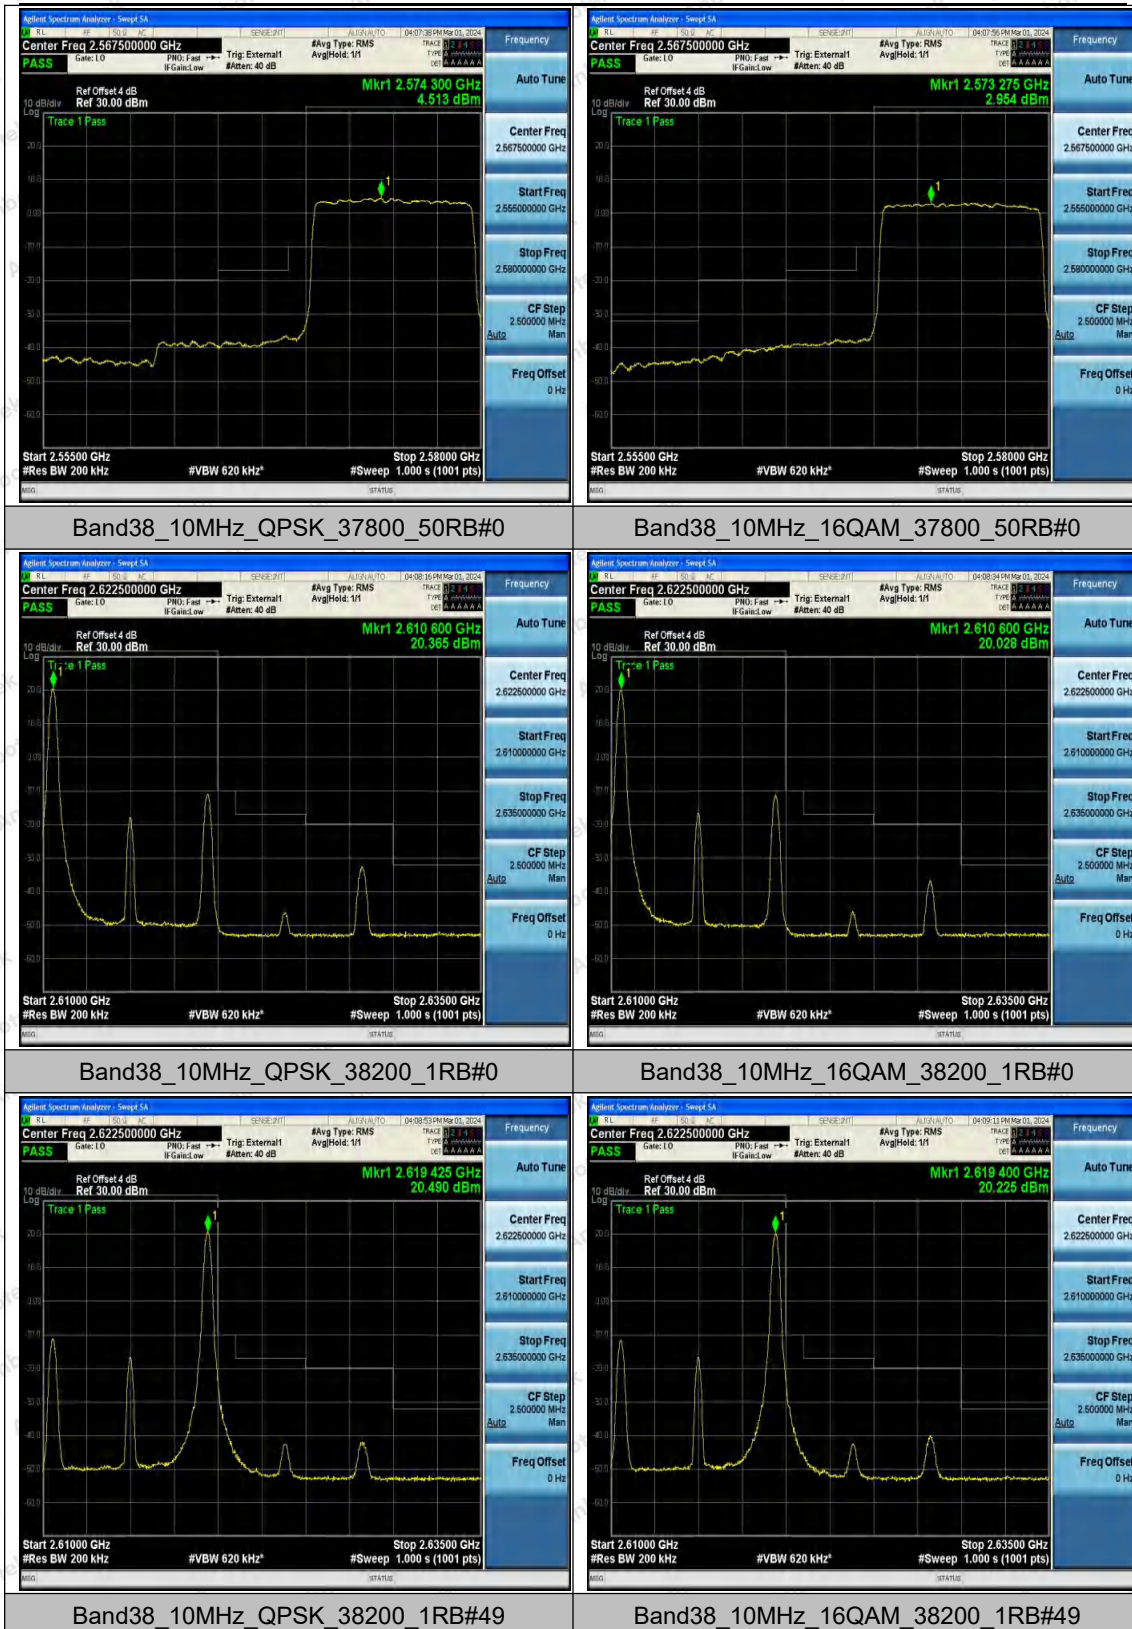

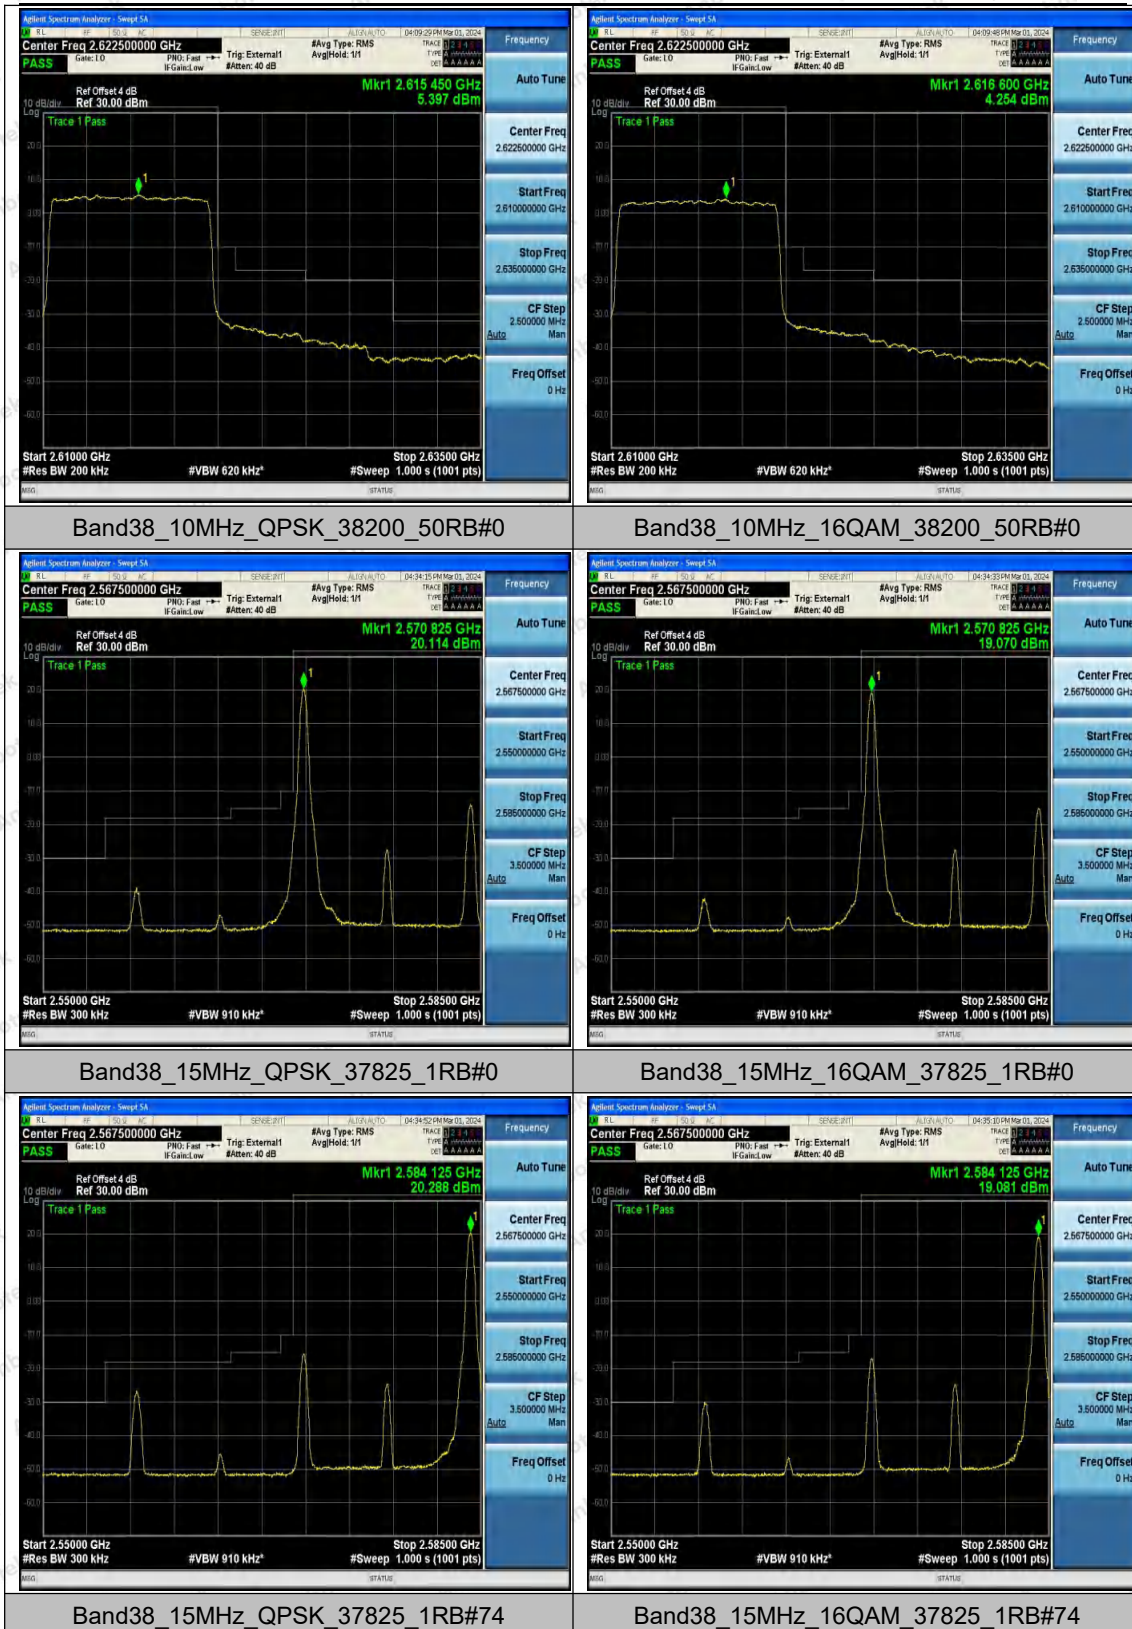


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



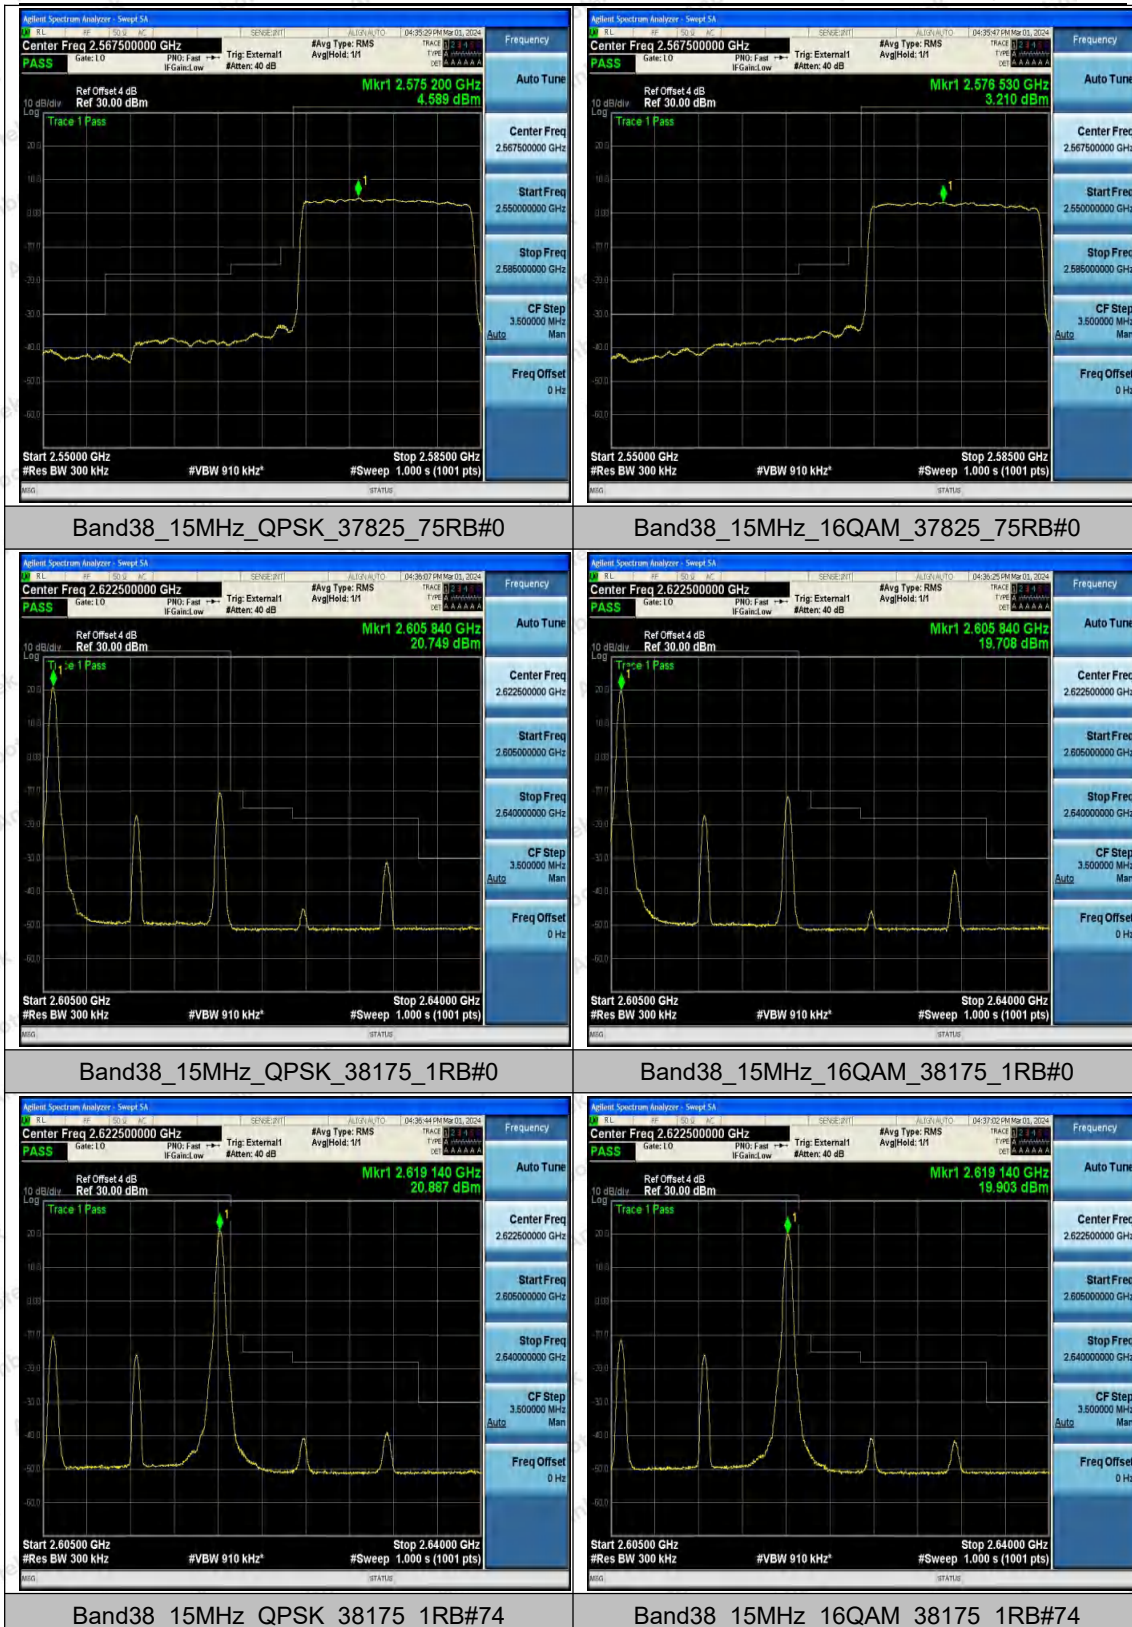

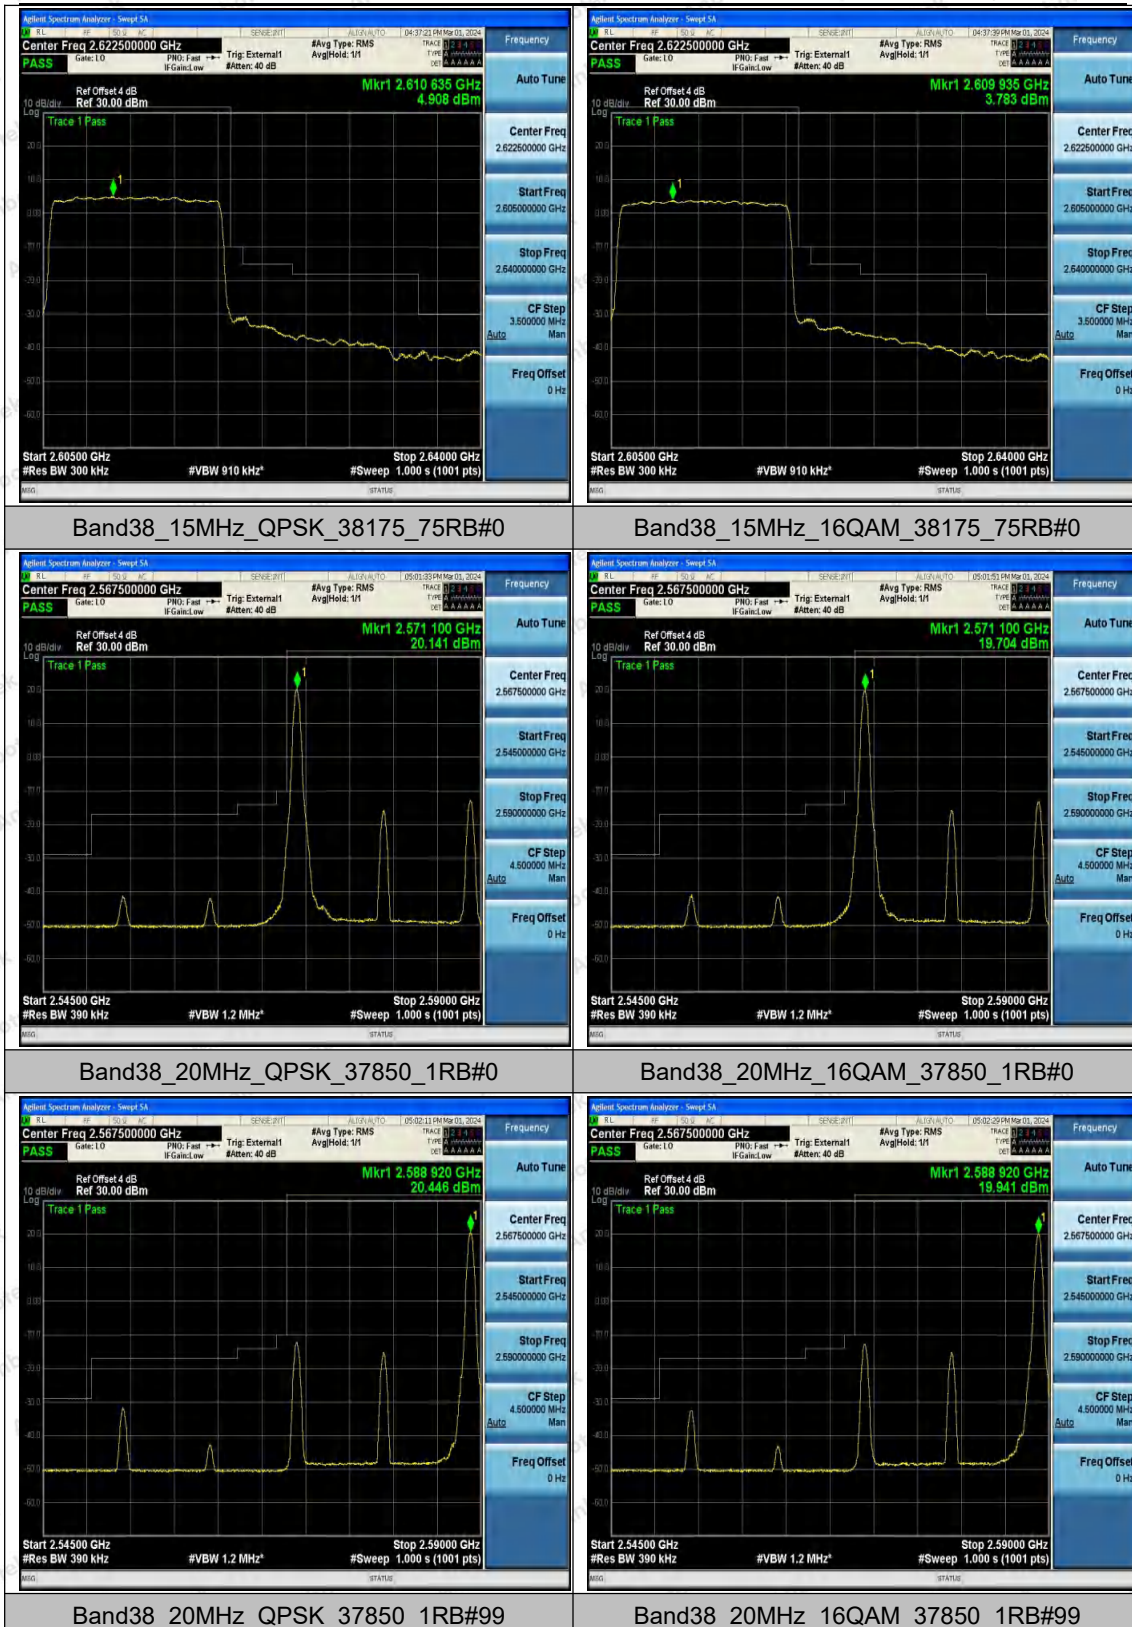


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



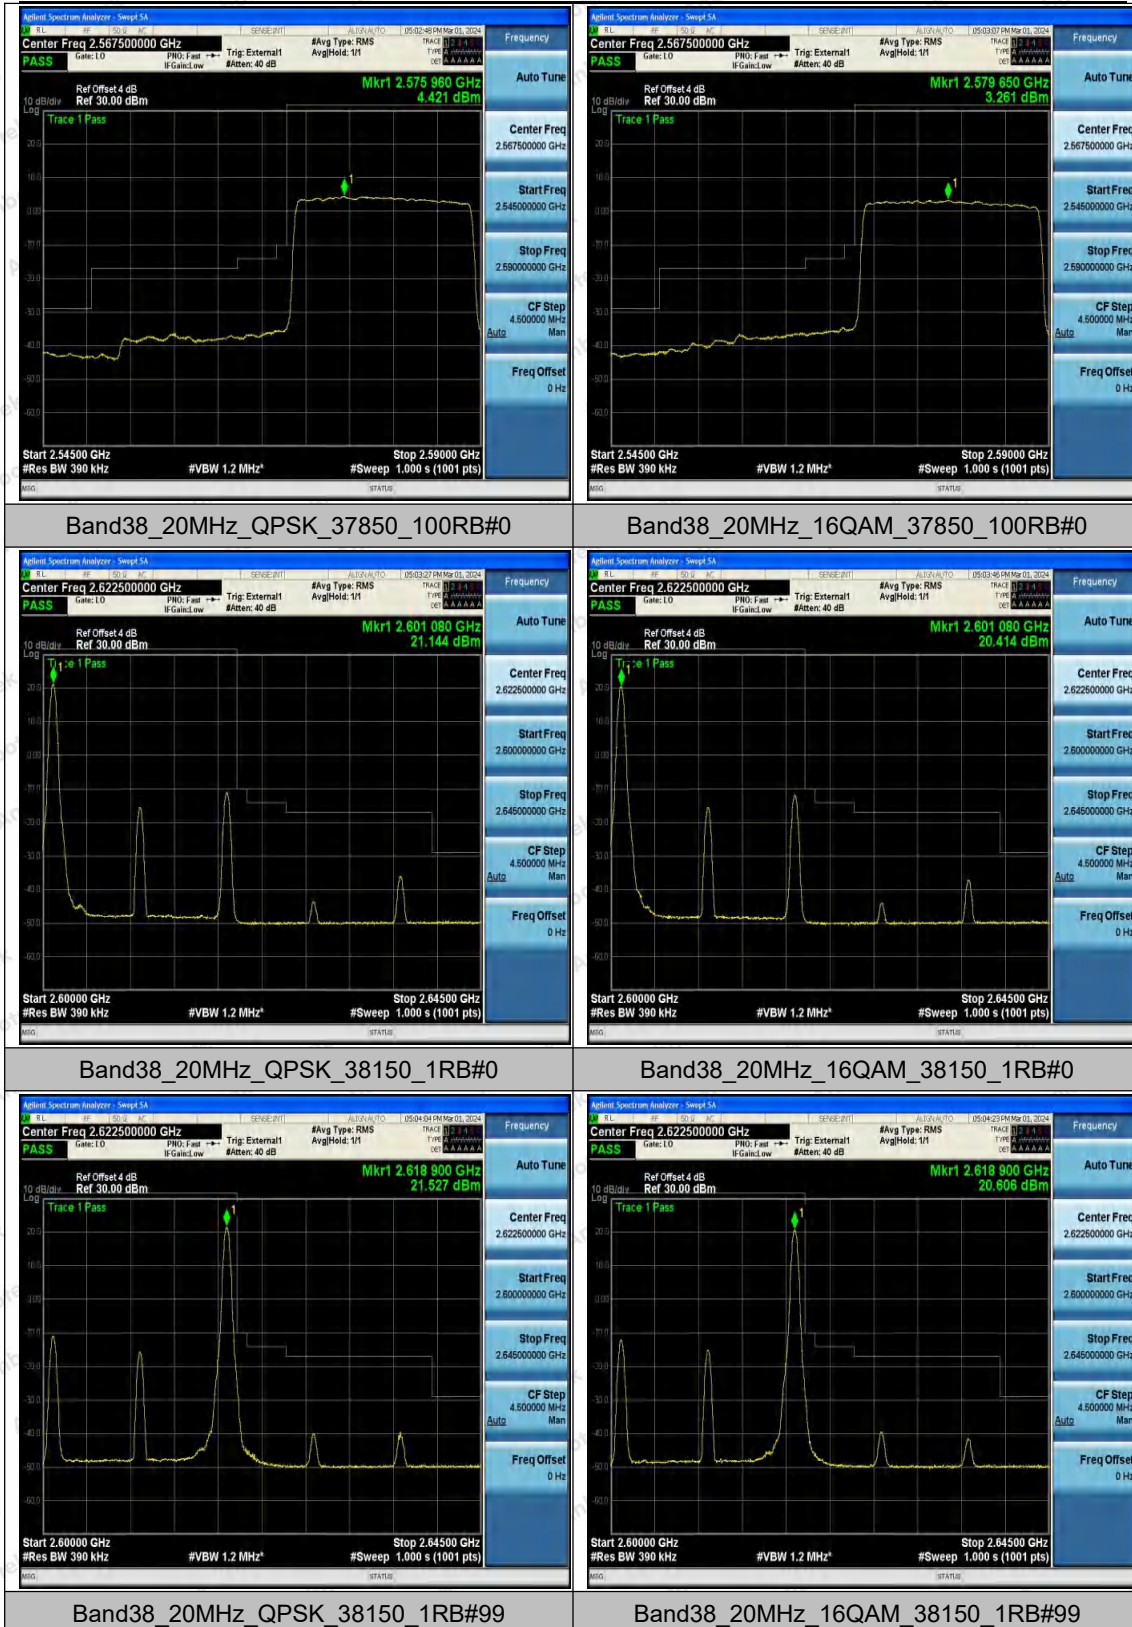



Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band38	5MHz	QPSK	37775	1RB#0	0.009~0.15	-69.22	PASS
Band38	5MHz	QPSK	37775	1RB#0	0.15~30	-62.24	PASS
Band38	5MHz	QPSK	37775	1RB#0	30~1000	-66.82	PASS
Band38	5MHz	QPSK	37775	1RB#0	20000~27000	-42.45	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.009~0.15	-70.02	PASS
Band38	5MHz	16QAM	37775	1RB#0	0.15~30	-62.21	PASS
Band38	5MHz	16QAM	37775	1RB#0	30~1000	-66.68	PASS
Band38	5MHz	16QAM	37775	1RB#0	20000~27000	-42.51	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.009~0.15	-71.79	PASS
Band38	5MHz	QPSK	38000	1RB#0	0.15~30	-69.81	PASS
Band38	5MHz	QPSK	38000	1RB#0	30~1000	-64.16	PASS
Band38	5MHz	QPSK	38000	1RB#0	20000~27000	-42.27	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.009~0.15	-70.86	PASS
Band38	5MHz	16QAM	38000	1RB#0	0.15~30	-68.19	PASS
Band38	5MHz	16QAM	38000	1RB#0	30~1000	-64.78	PASS
Band38	5MHz	16QAM	38000	1RB#0	20000~27000	-42.26	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.009~0.15	-68.30	PASS
Band38	5MHz	QPSK	38225	1RB#0	0.15~30	-66.30	PASS
Band38	5MHz	QPSK	38225	1RB#0	30~1000	-64.06	PASS
Band38	5MHz	QPSK	38225	1RB#0	20000~27000	-42.41	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.009~0.15	-70.98	PASS
Band38	5MHz	16QAM	38225	1RB#0	0.15~30	-69.56	PASS
Band38	5MHz	16QAM	38225	1RB#0	30~1000	-65.66	PASS
Band38	5MHz	16QAM	38225	1RB#0	20000~27000	-42.36	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.009~0.15	-70.83	PASS
Band38	10MHz	QPSK	37800	1RB#0	0.15~30	-60.55	PASS
Band38	10MHz	QPSK	37800	1RB#0	30~1000	-66.64	PASS
Band38	10MHz	QPSK	37800	1RB#0	20000~27000	-42.09	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.009~0.15	-71.13	PASS
Band38	10MHz	16QAM	37800	1RB#0	0.15~30	-61.85	PASS
Band38	10MHz	16QAM	37800	1RB#0	30~1000	-66.63	PASS
Band38	10MHz	16QAM	37800	1RB#0	20000~27000	-42.17	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.009~0.15	-72.62	PASS
Band38	10MHz	QPSK	38000	1RB#0	0.15~30	-61.03	PASS
Band38	10MHz	QPSK	38000	1RB#0	30~1000	-66.52	PASS
Band38	10MHz	QPSK	38000	1RB#0	20000~27000	-41.95	PASS
Band38	10MHz	16QAM	38000	1RB#0	0.009~0.15	-69.12	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38000	1RB#0	0.15~30	-64.18	PASS
Band38	10MHz	16QAM	38000	1RB#0	30~1000	-66.81	PASS
Band38	10MHz	16QAM	38000	1RB#0	20000~27000	-41.77	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.009~0.15	-69.27	PASS
Band38	10MHz	QPSK	38200	1RB#0	0.15~30	-68.08	PASS
Band38	10MHz	QPSK	38200	1RB#0	30~1000	-64.41	PASS
Band38	10MHz	QPSK	38200	1RB#0	20000~27000	-41.56	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.009~0.15	-68.31	PASS
Band38	10MHz	16QAM	38200	1RB#0	0.15~30	-70.34	PASS
Band38	10MHz	16QAM	38200	1RB#0	30~1000	-65.20	PASS
Band38	10MHz	16QAM	38200	1RB#0	20000~27000	-42.25	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.009~0.15	-70.63	PASS
Band38	15MHz	QPSK	37825	1RB#0	0.15~30	-60.77	PASS
Band38	15MHz	QPSK	37825	1RB#0	30~1000	-66.65	PASS
Band38	15MHz	QPSK	37825	1RB#0	20000~27000	-41.96	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.009~0.15	-71.11	PASS
Band38	15MHz	16QAM	37825	1RB#0	0.15~30	-63.21	PASS
Band38	15MHz	16QAM	37825	1RB#0	30~1000	-66.71	PASS
Band38	15MHz	16QAM	37825	1RB#0	20000~27000	-42.26	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.009~0.15	-72.34	PASS
Band38	15MHz	QPSK	38000	1RB#0	0.15~30	-59.71	PASS
Band38	15MHz	QPSK	38000	1RB#0	30~1000	-66.71	PASS
Band38	15MHz	QPSK	38000	1RB#0	20000~27000	-41.93	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.009~0.15	-70.39	PASS
Band38	15MHz	16QAM	38000	1RB#0	0.15~30	-63.32	PASS
Band38	15MHz	16QAM	38000	1RB#0	30~1000	-66.84	PASS
Band38	15MHz	16QAM	38000	1RB#0	20000~27000	-41.97	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.009~0.15	-70.45	PASS
Band38	15MHz	QPSK	38175	1RB#0	0.15~30	-67.38	PASS
Band38	15MHz	QPSK	38175	1RB#0	30~1000	-64.39	PASS
Band38	15MHz	QPSK	38175	1RB#0	20000~27000	-41.91	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.009~0.15	-70.94	PASS
Band38	15MHz	16QAM	38175	1RB#0	0.15~30	-69.12	PASS
Band38	15MHz	16QAM	38175	1RB#0	30~1000	-65.31	PASS
Band38	15MHz	16QAM	38175	1RB#0	20000~27000	-42.11	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.009~0.15	-69.61	PASS
Band38	20MHz	QPSK	37850	1RB#0	0.15~30	-61.55	PASS
Band38	20MHz	QPSK	37850	1RB#0	30~1000	-66.87	PASS
Band38	20MHz	QPSK	37850	1RB#0	20000~27000	-42.20	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.009~0.15	-69.24	PASS
Band38	20MHz	16QAM	37850	1RB#0	0.15~30	-64.18	PASS
Band38	20MHz	16QAM	37850	1RB#0	30~1000	-66.63	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline


400-003-0500

www.anbotek.com.cn



Band38	20MHz	16QAM	37850	1RB#0	20000~27000	-42.18	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.009~0.15	-71.49	PASS
Band38	20MHz	QPSK	38000	1RB#0	0.15~30	-60.05	PASS
Band38	20MHz	QPSK	38000	1RB#0	30~1000	-66.86	PASS
Band38	20MHz	QPSK	38000	1RB#0	20000~27000	-42.14	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.009~0.15	-71.93	PASS
Band38	20MHz	16QAM	38000	1RB#0	0.15~30	-61.35	PASS
Band38	20MHz	16QAM	38000	1RB#0	30~1000	-66.90	PASS
Band38	20MHz	16QAM	38000	1RB#0	20000~27000	-42.14	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.009~0.15	-68.68	PASS
Band38	20MHz	QPSK	38150	1RB#0	0.15~30	-67.47	PASS
Band38	20MHz	QPSK	38150	1RB#0	30~1000	-64.30	PASS
Band38	20MHz	QPSK	38150	1RB#0	20000~27000	-42.13	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.009~0.15	-69.44	PASS
Band38	20MHz	16QAM	38150	1RB#0	0.15~30	-67.59	PASS
Band38	20MHz	16QAM	38150	1RB#0	30~1000	-64.98	PASS
Band38	20MHz	16QAM	38150	1RB#0	20000~27000	-41.87	PASS

Test Graphs

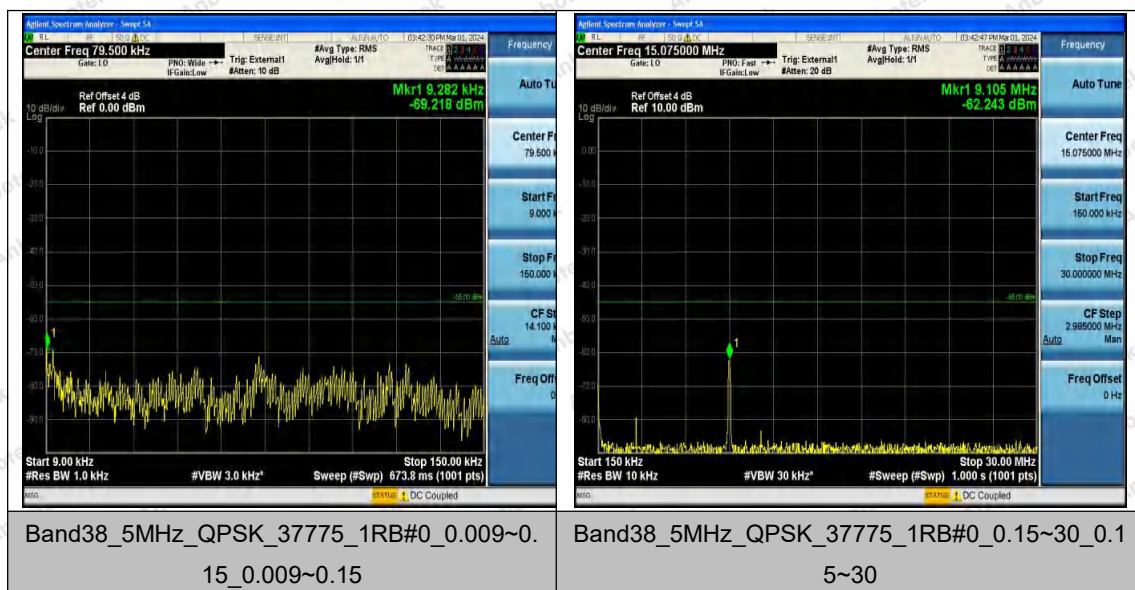


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



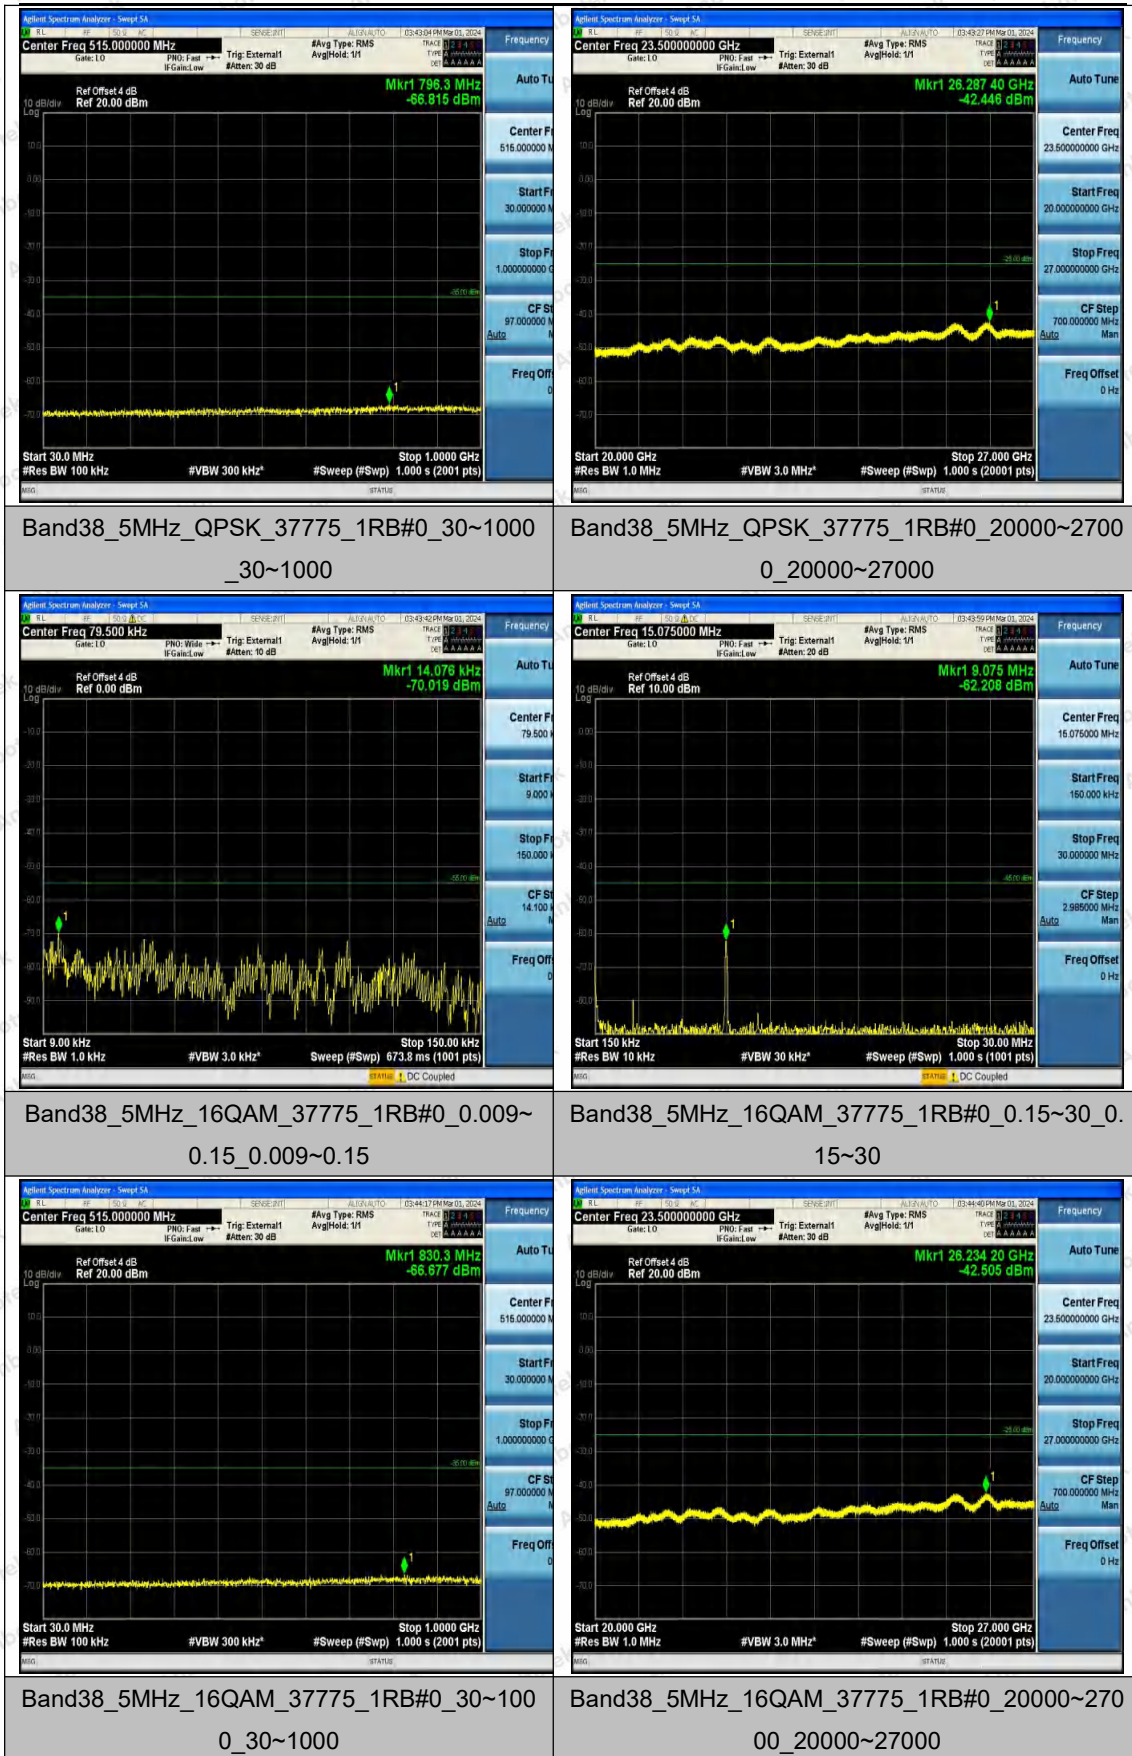


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



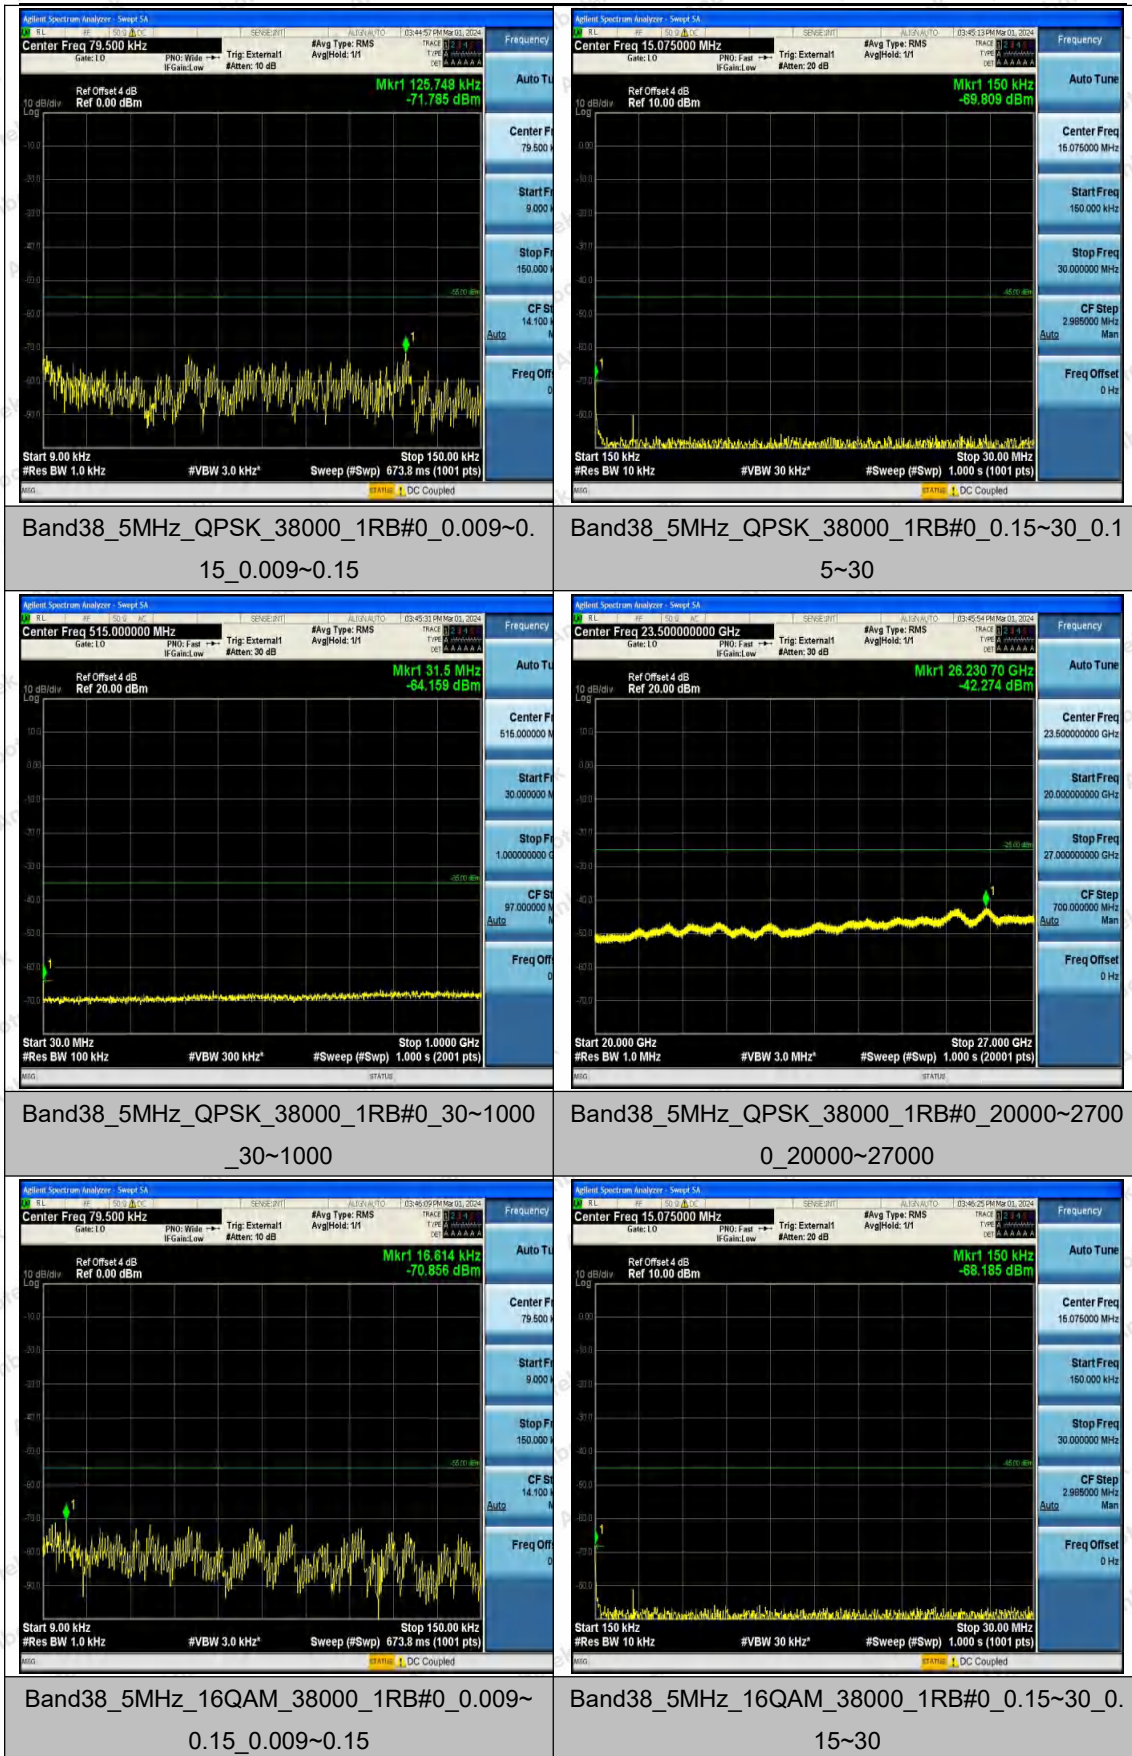


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



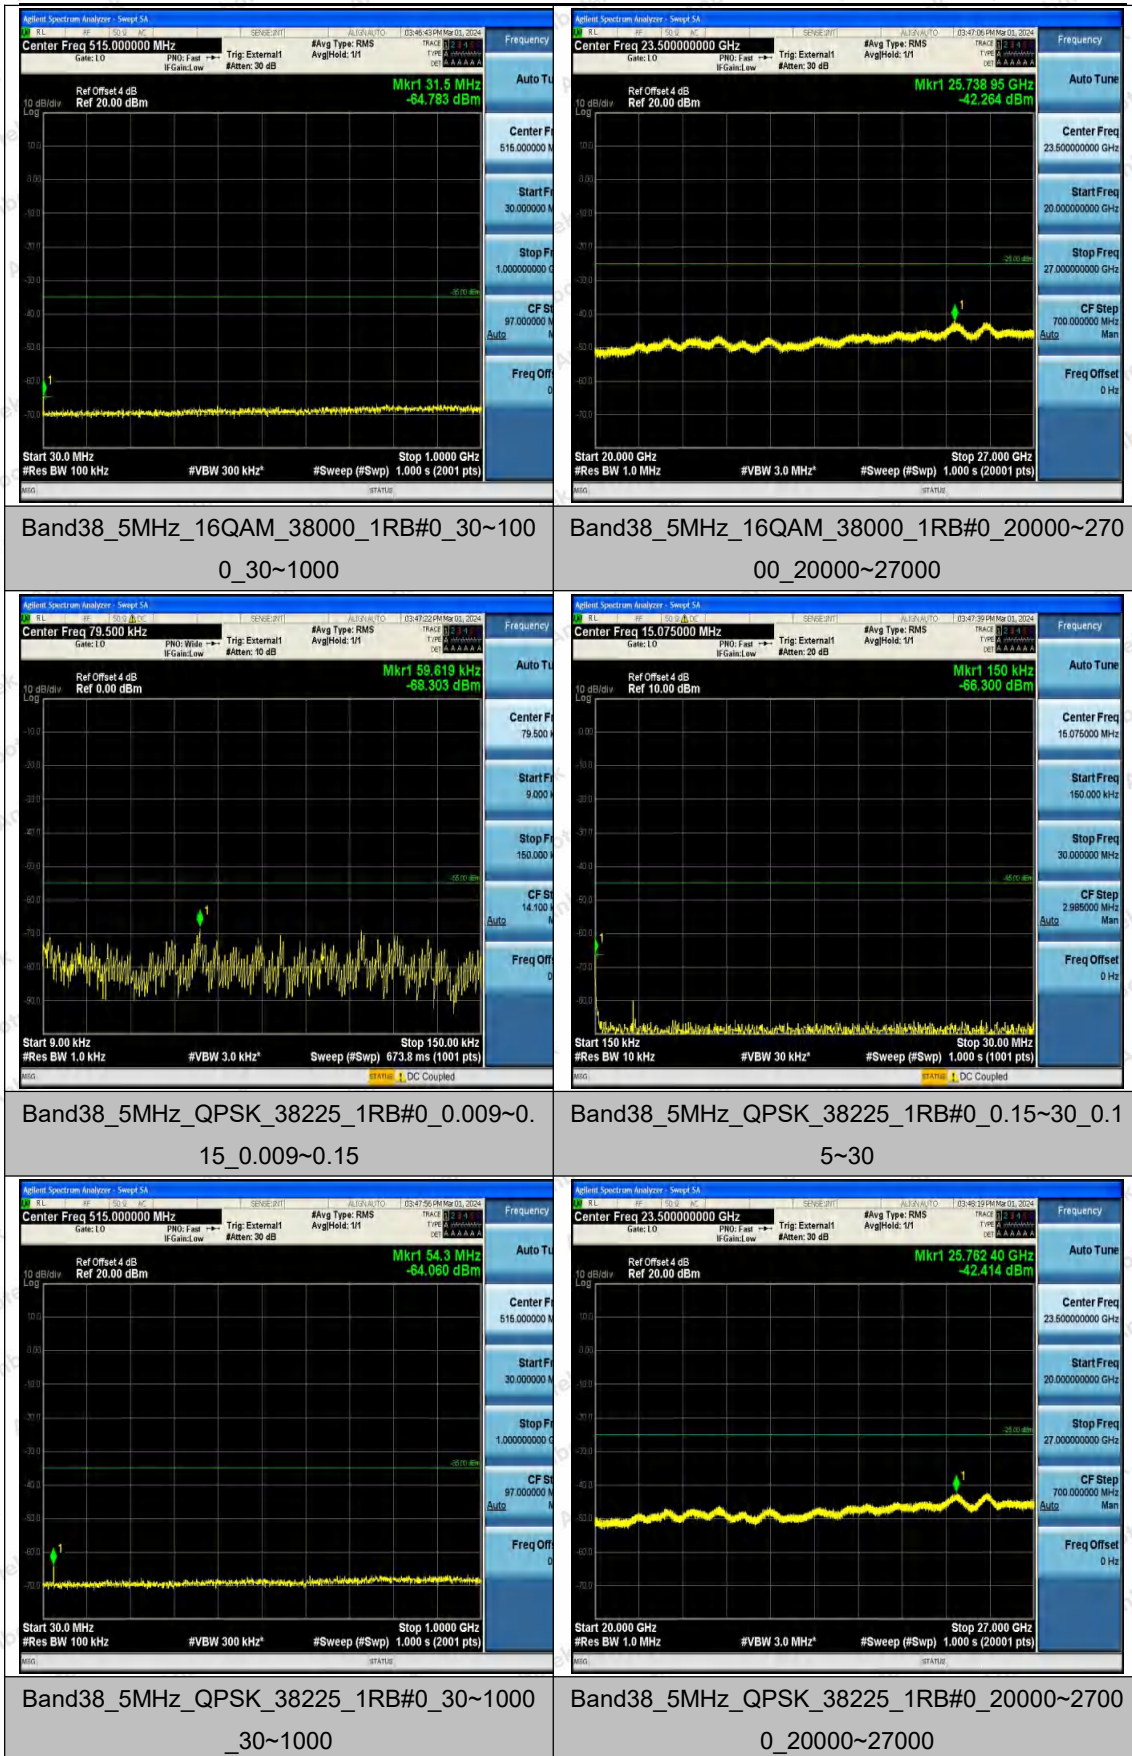


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



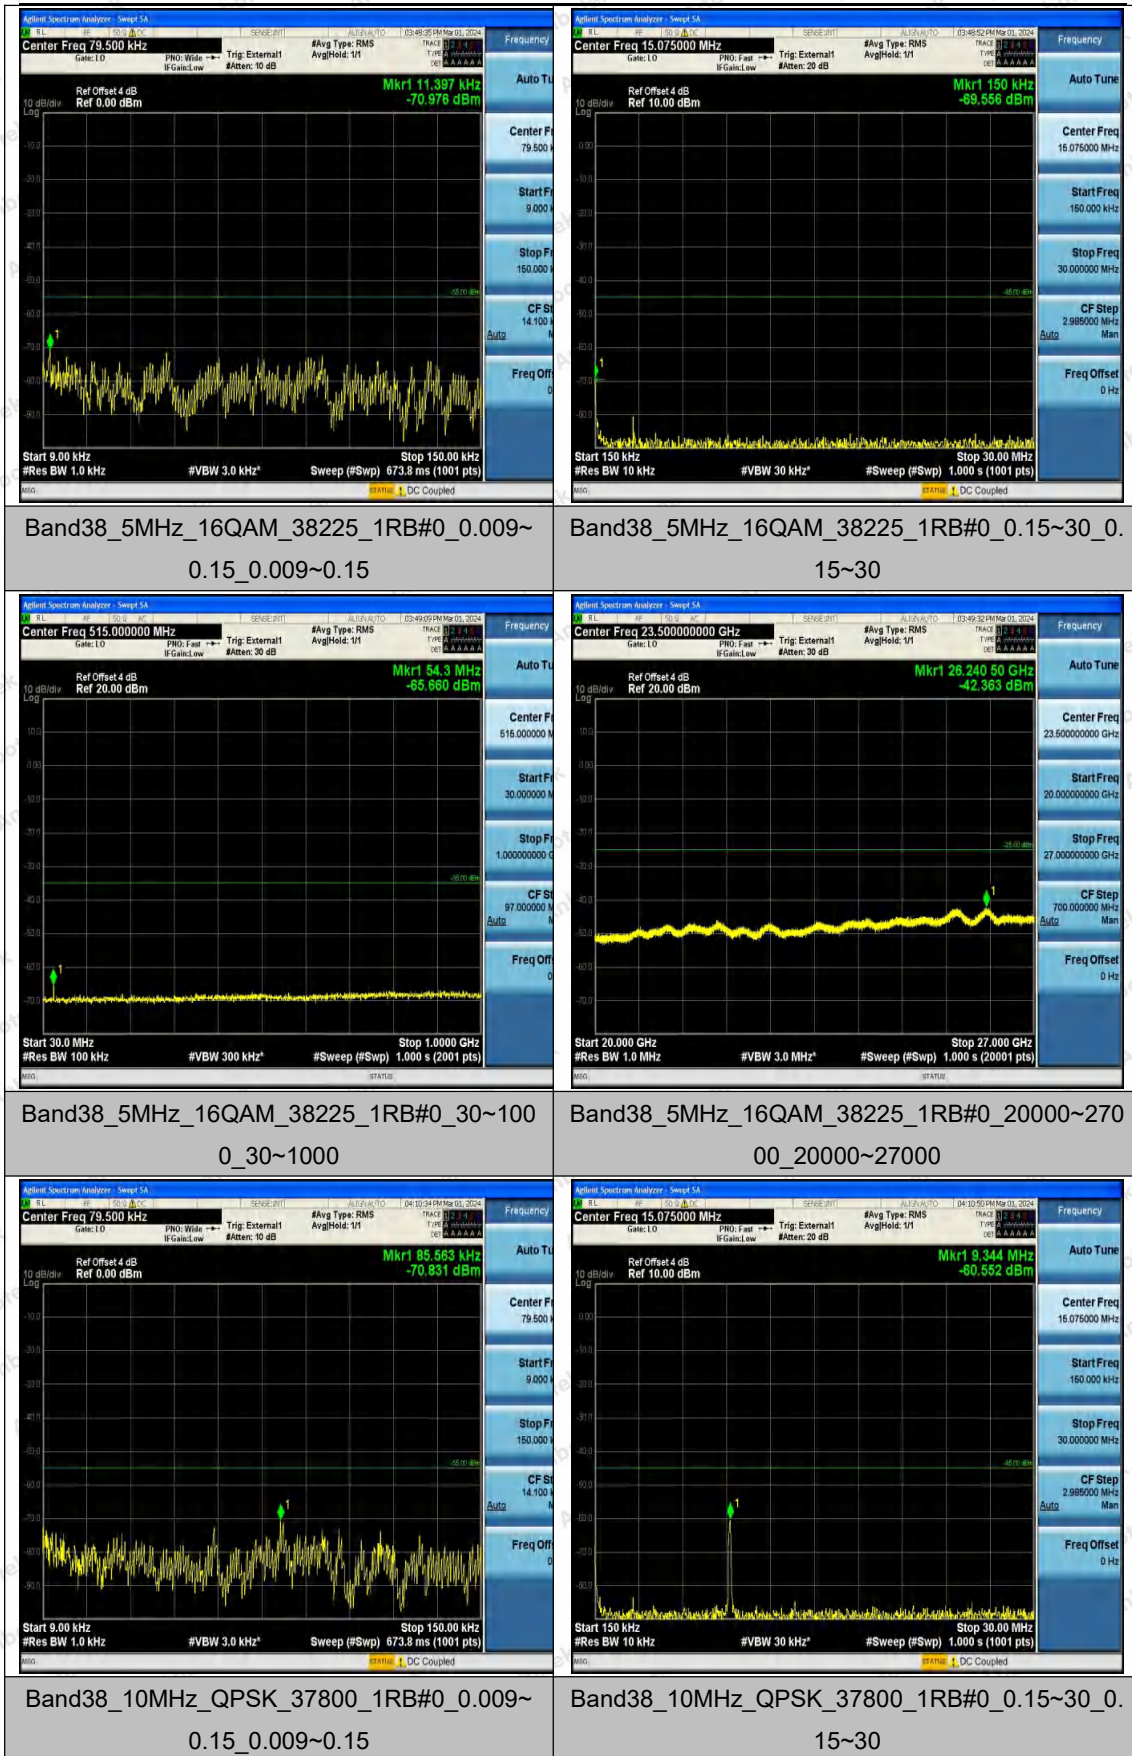


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



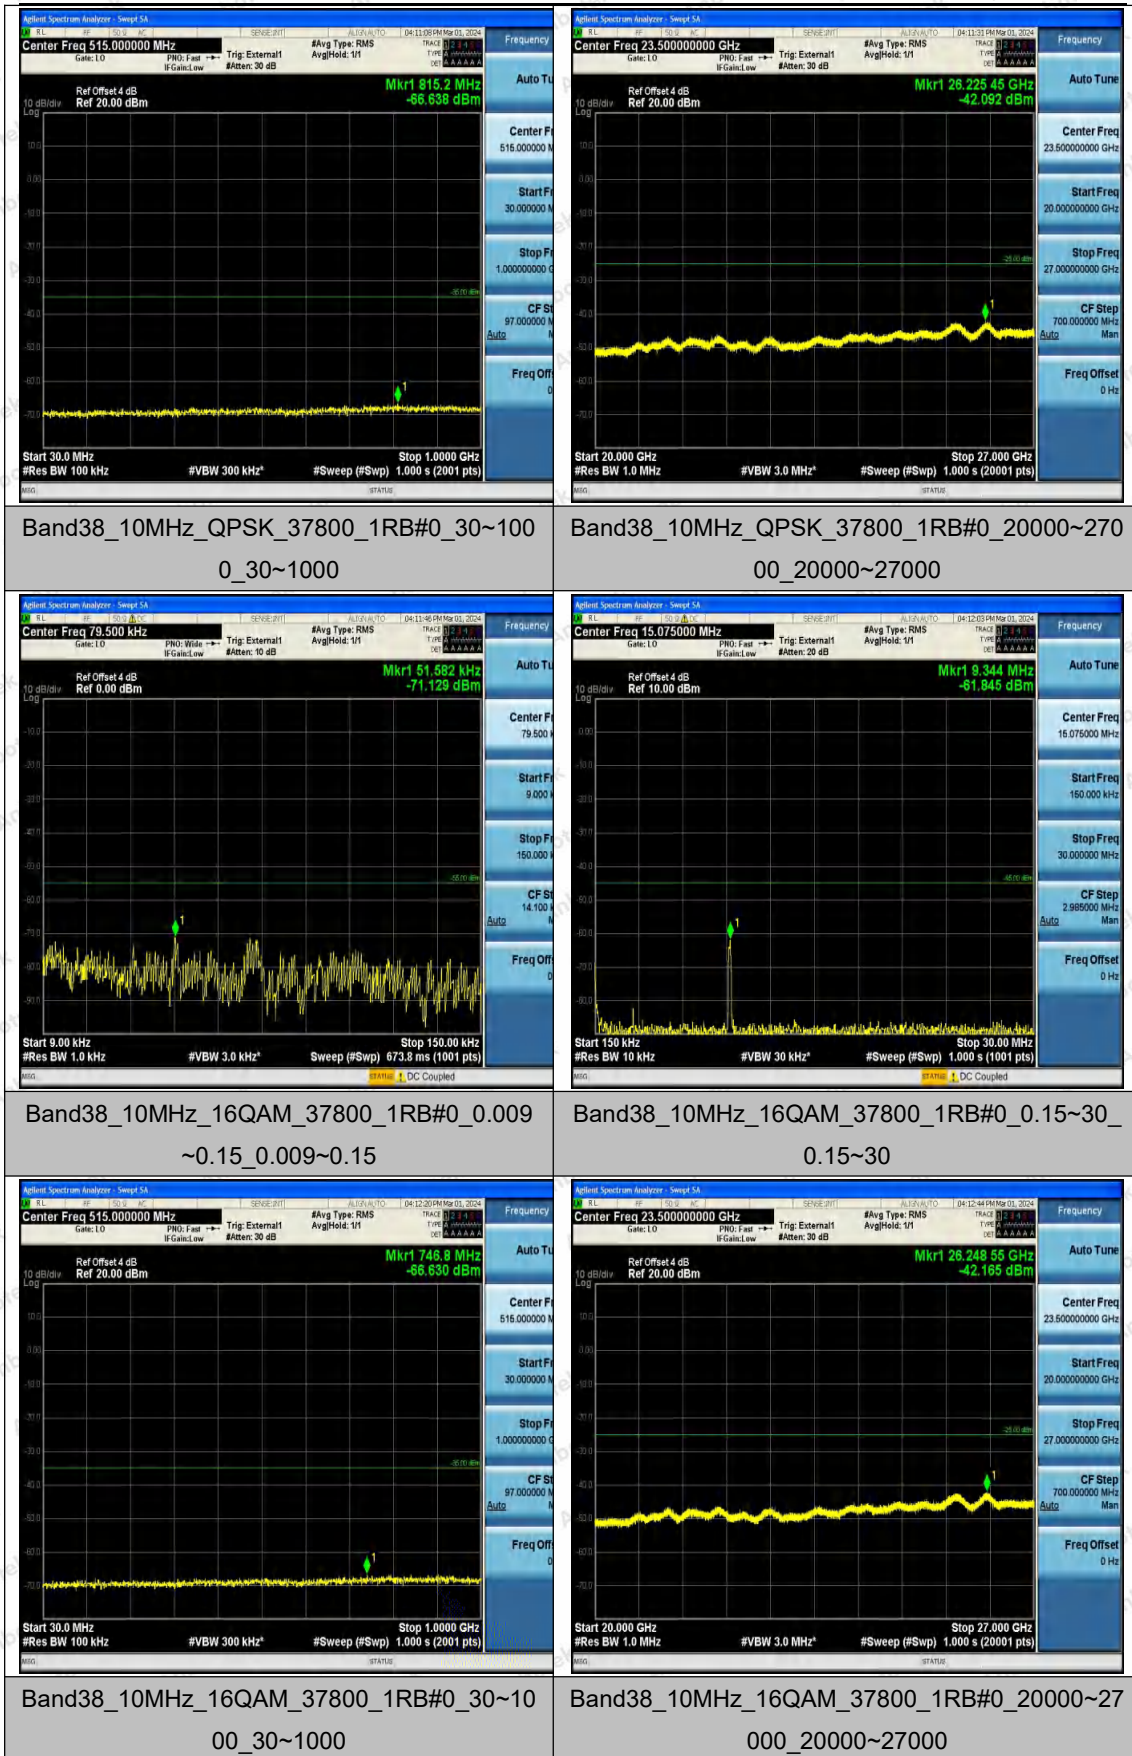


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



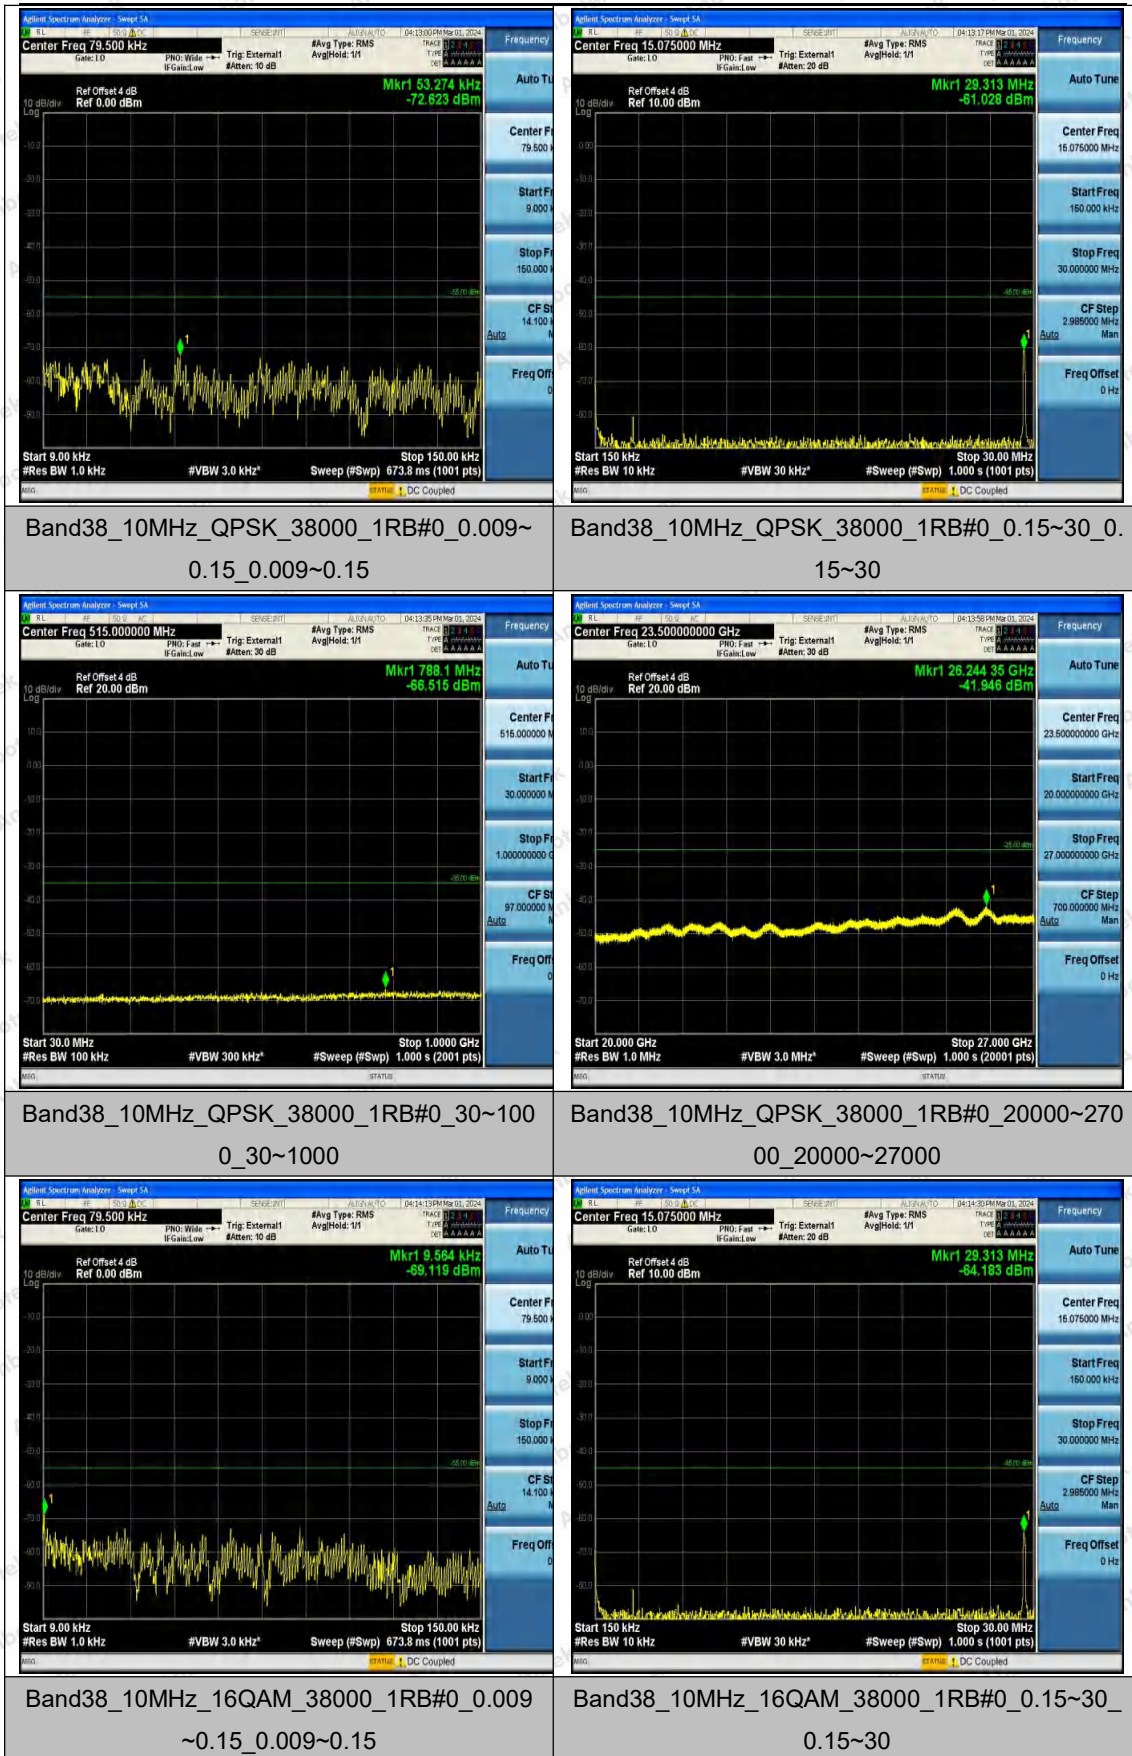


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



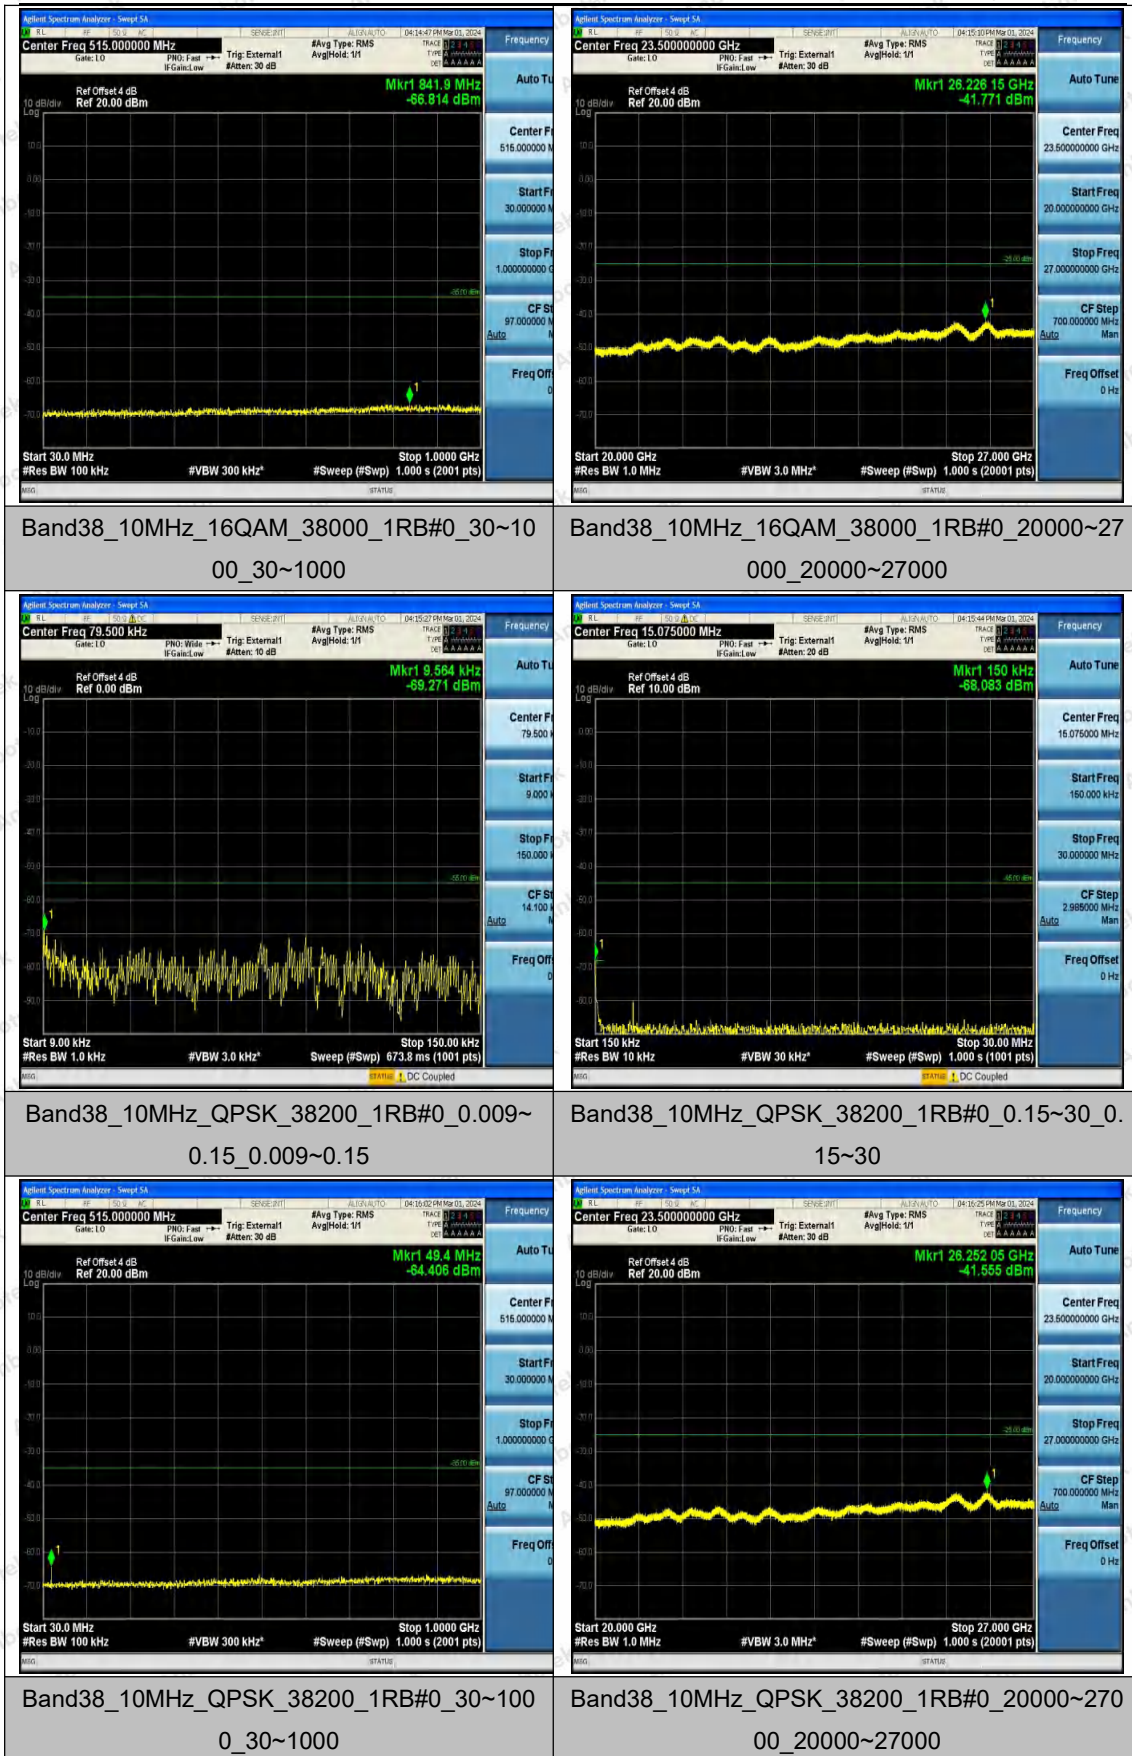


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



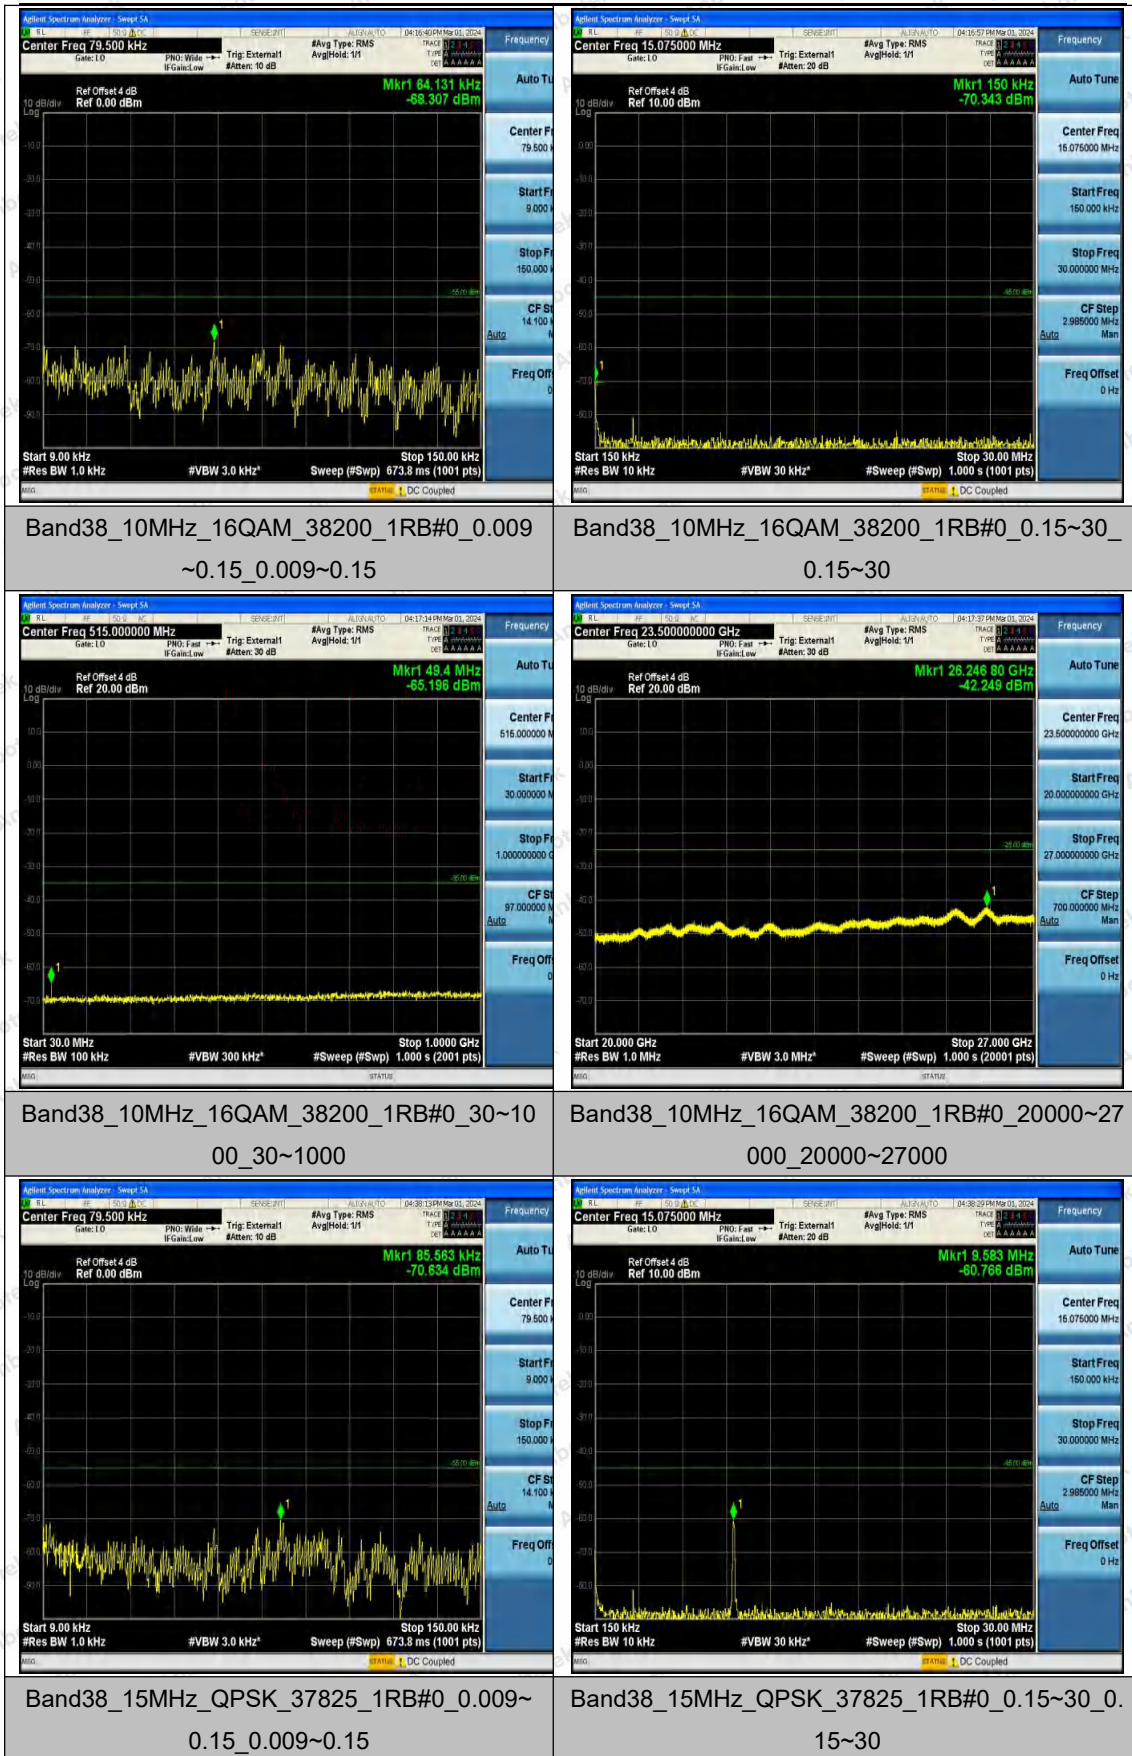


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



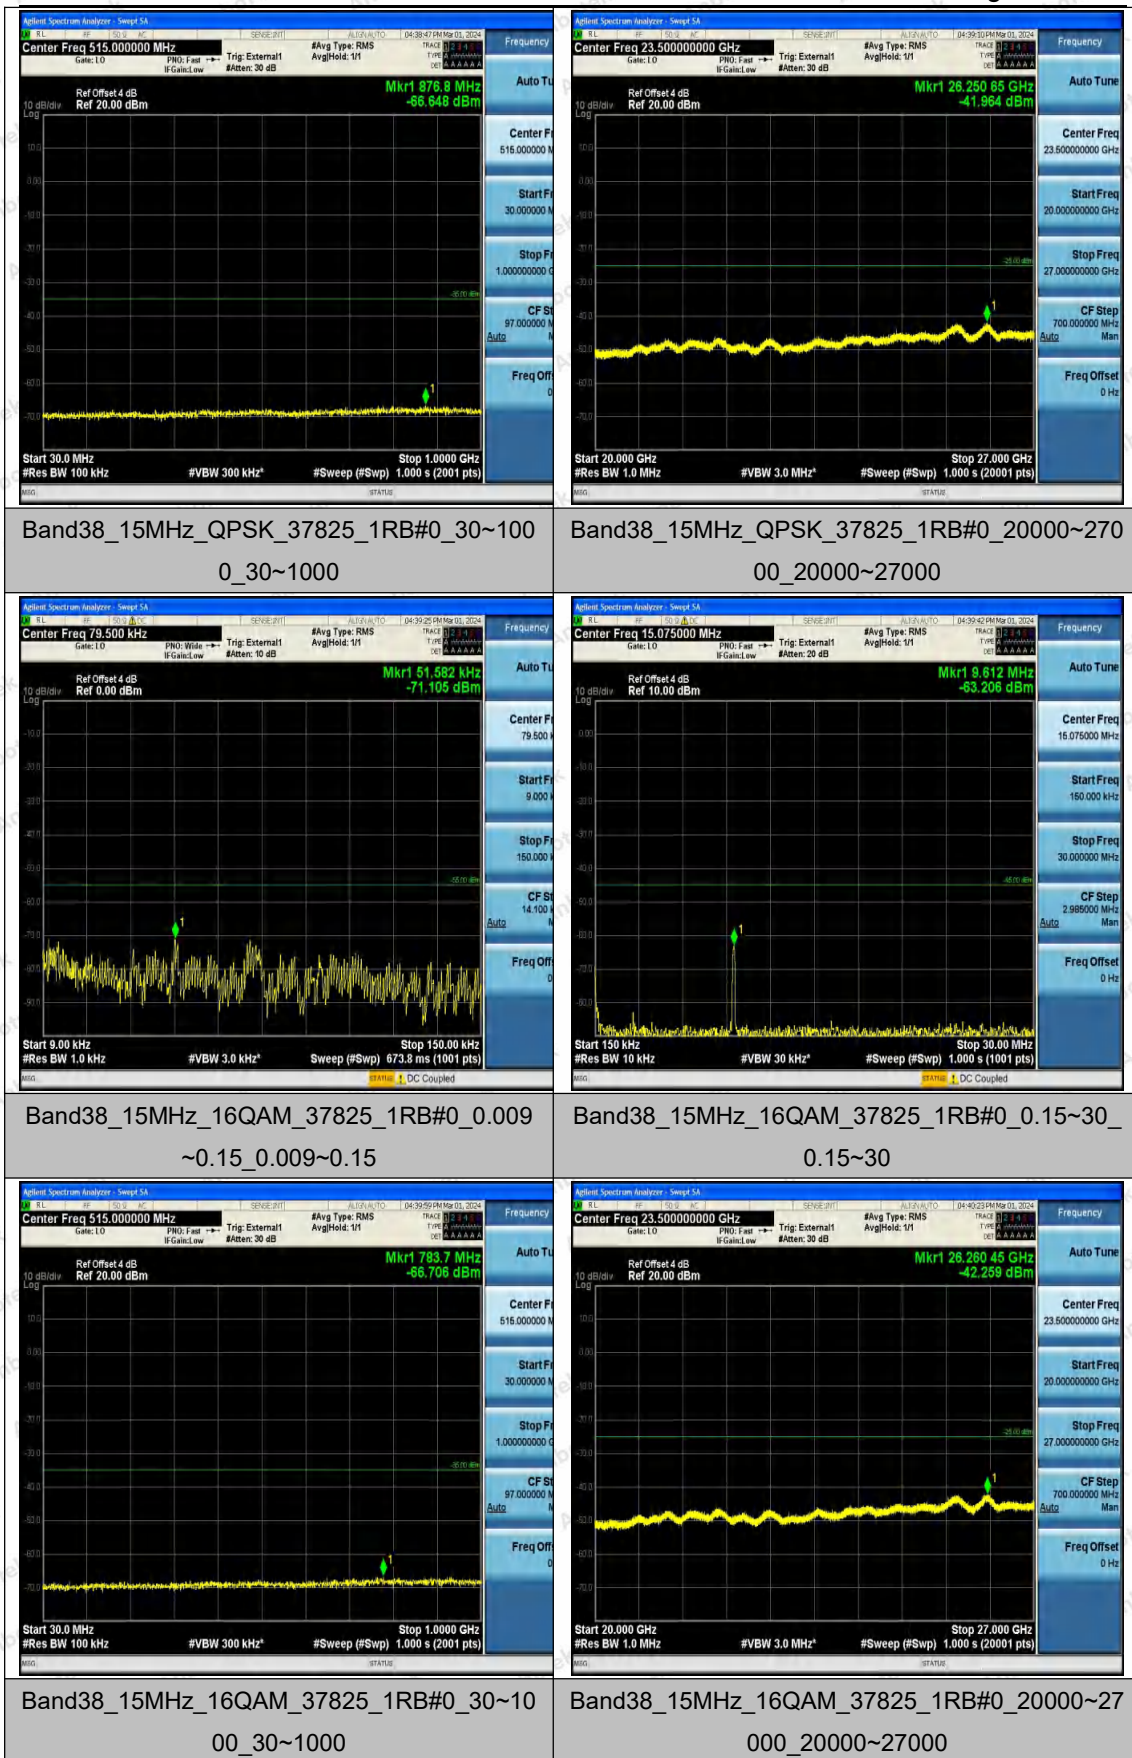


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



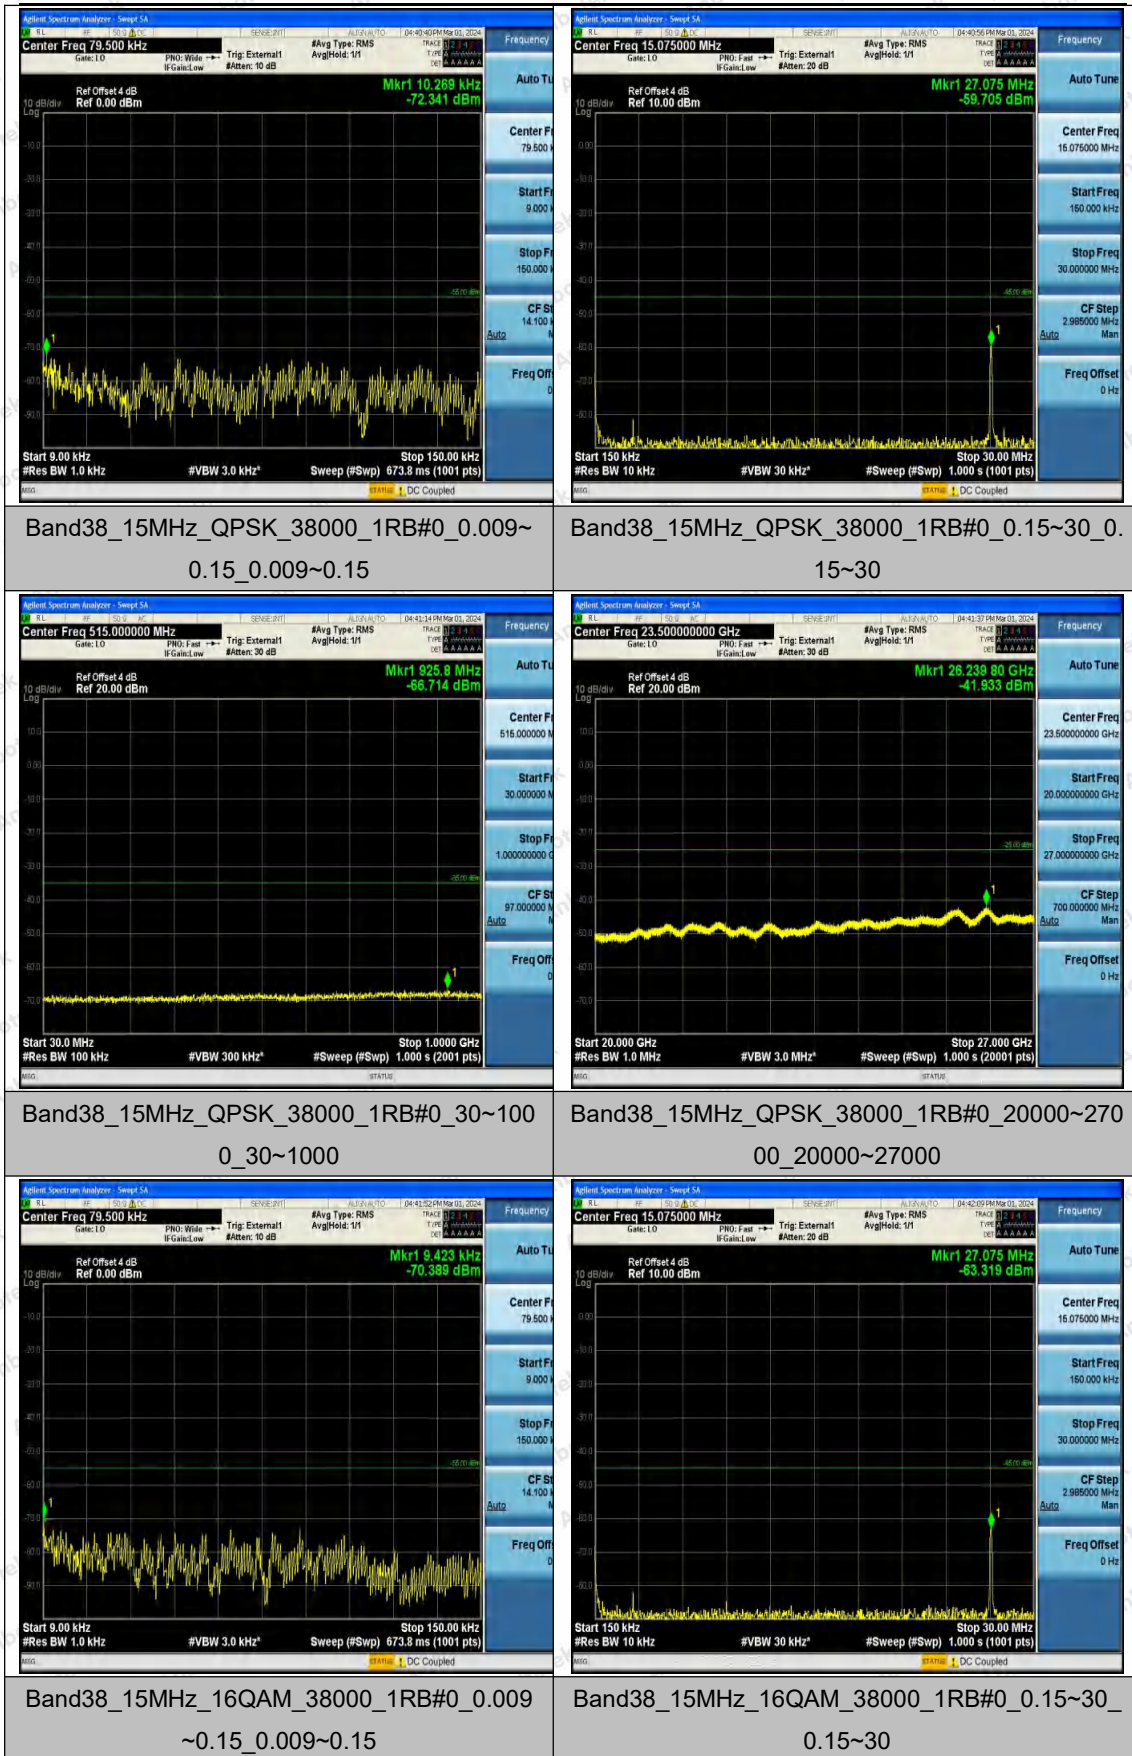


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



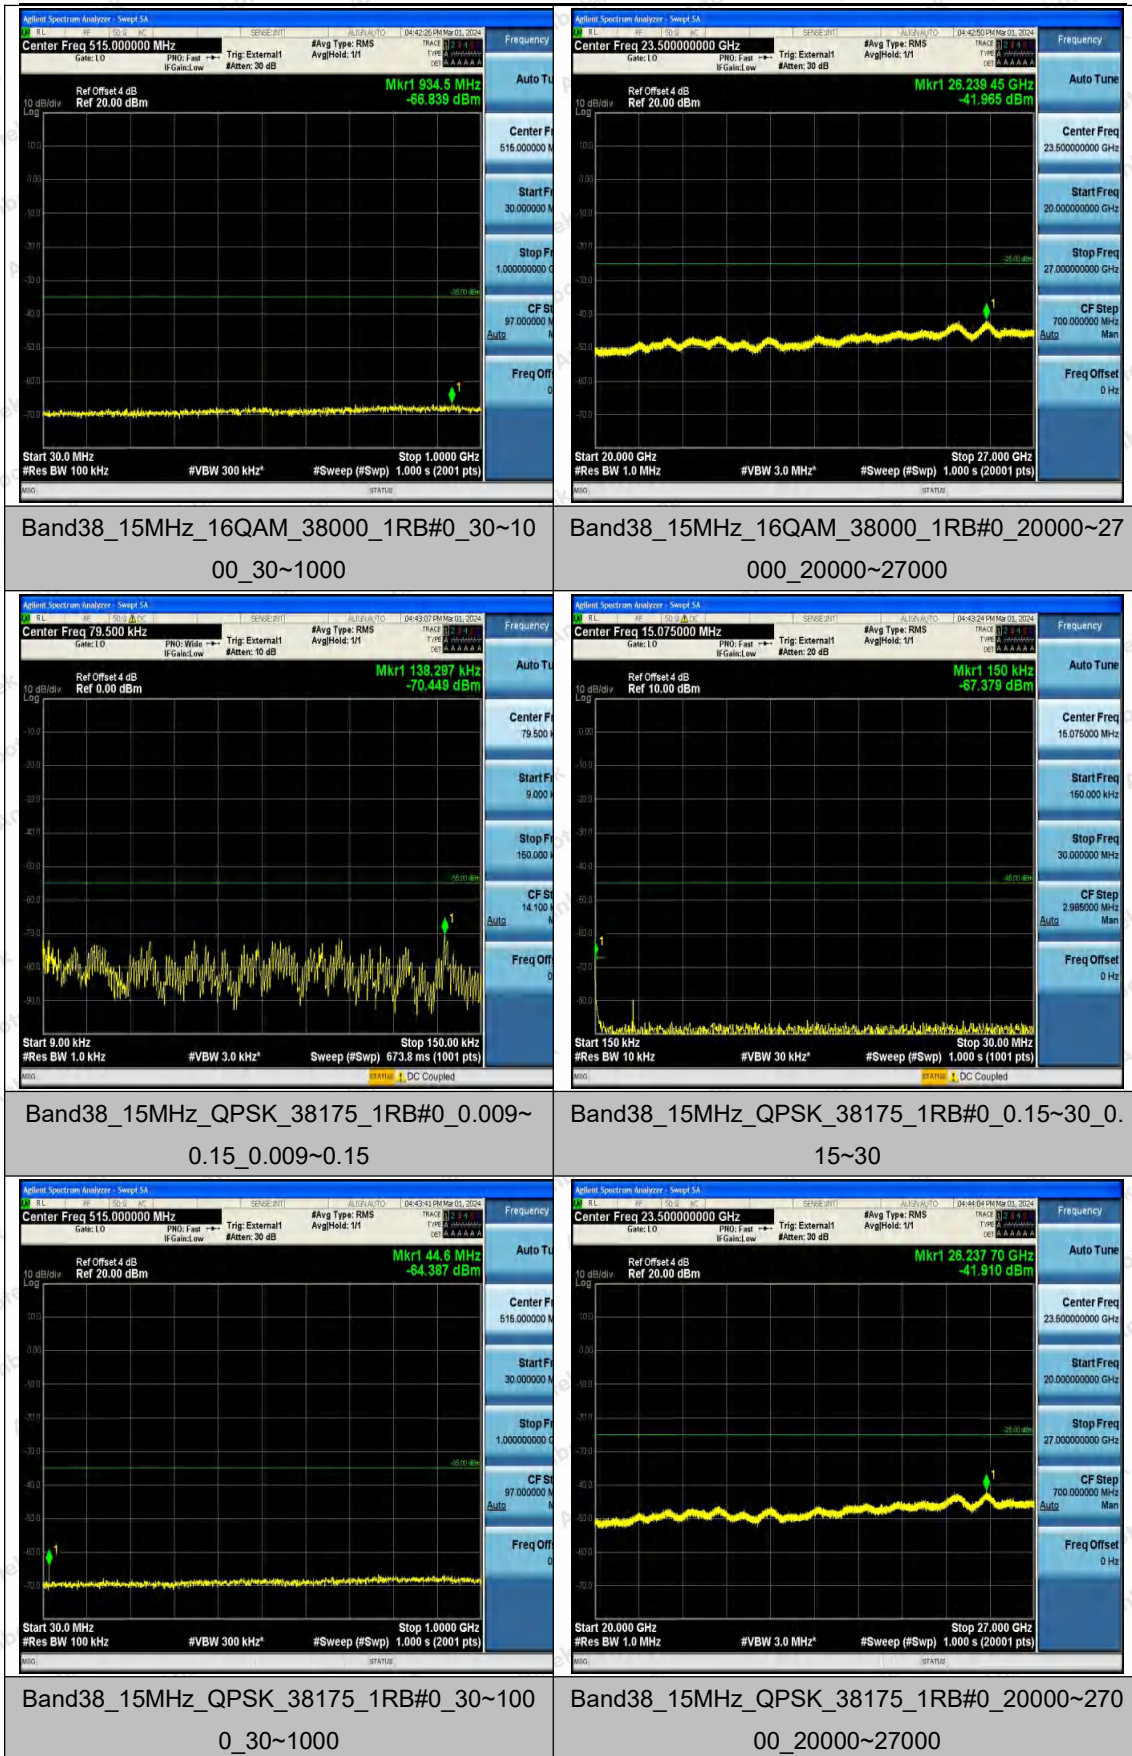


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



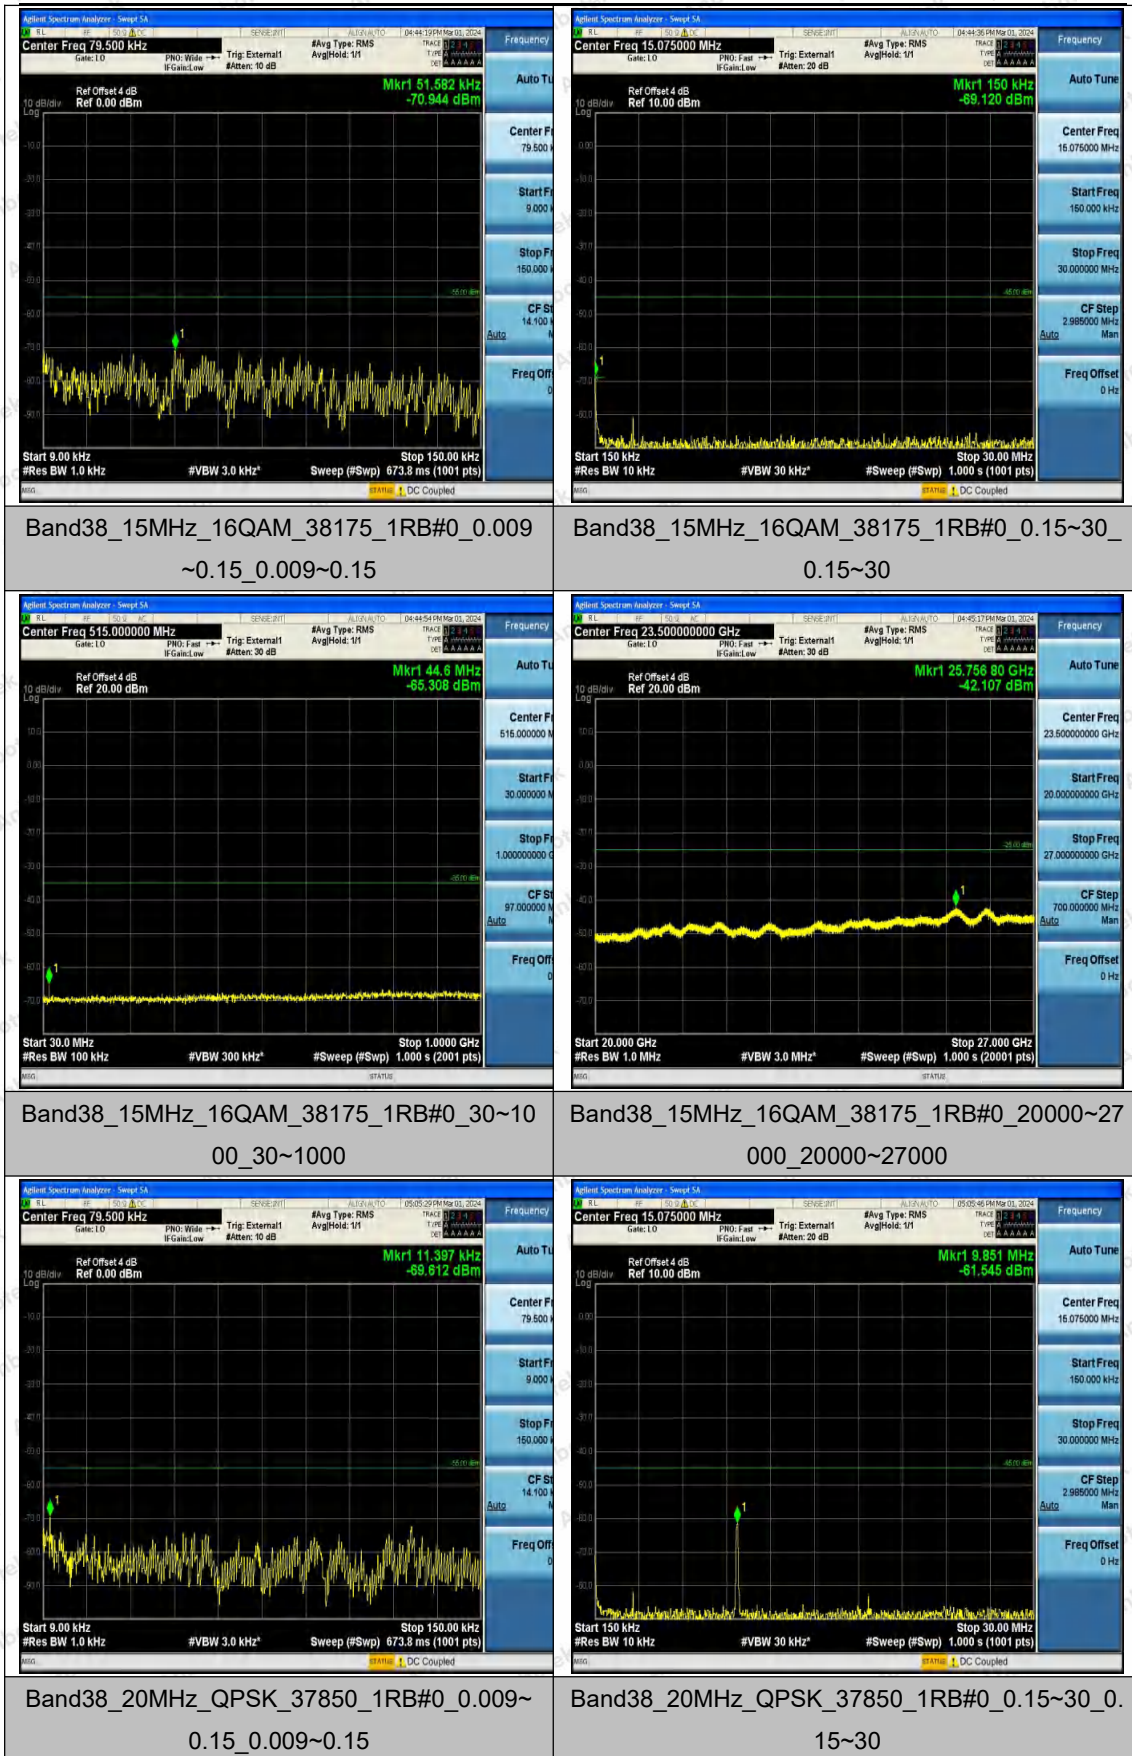


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



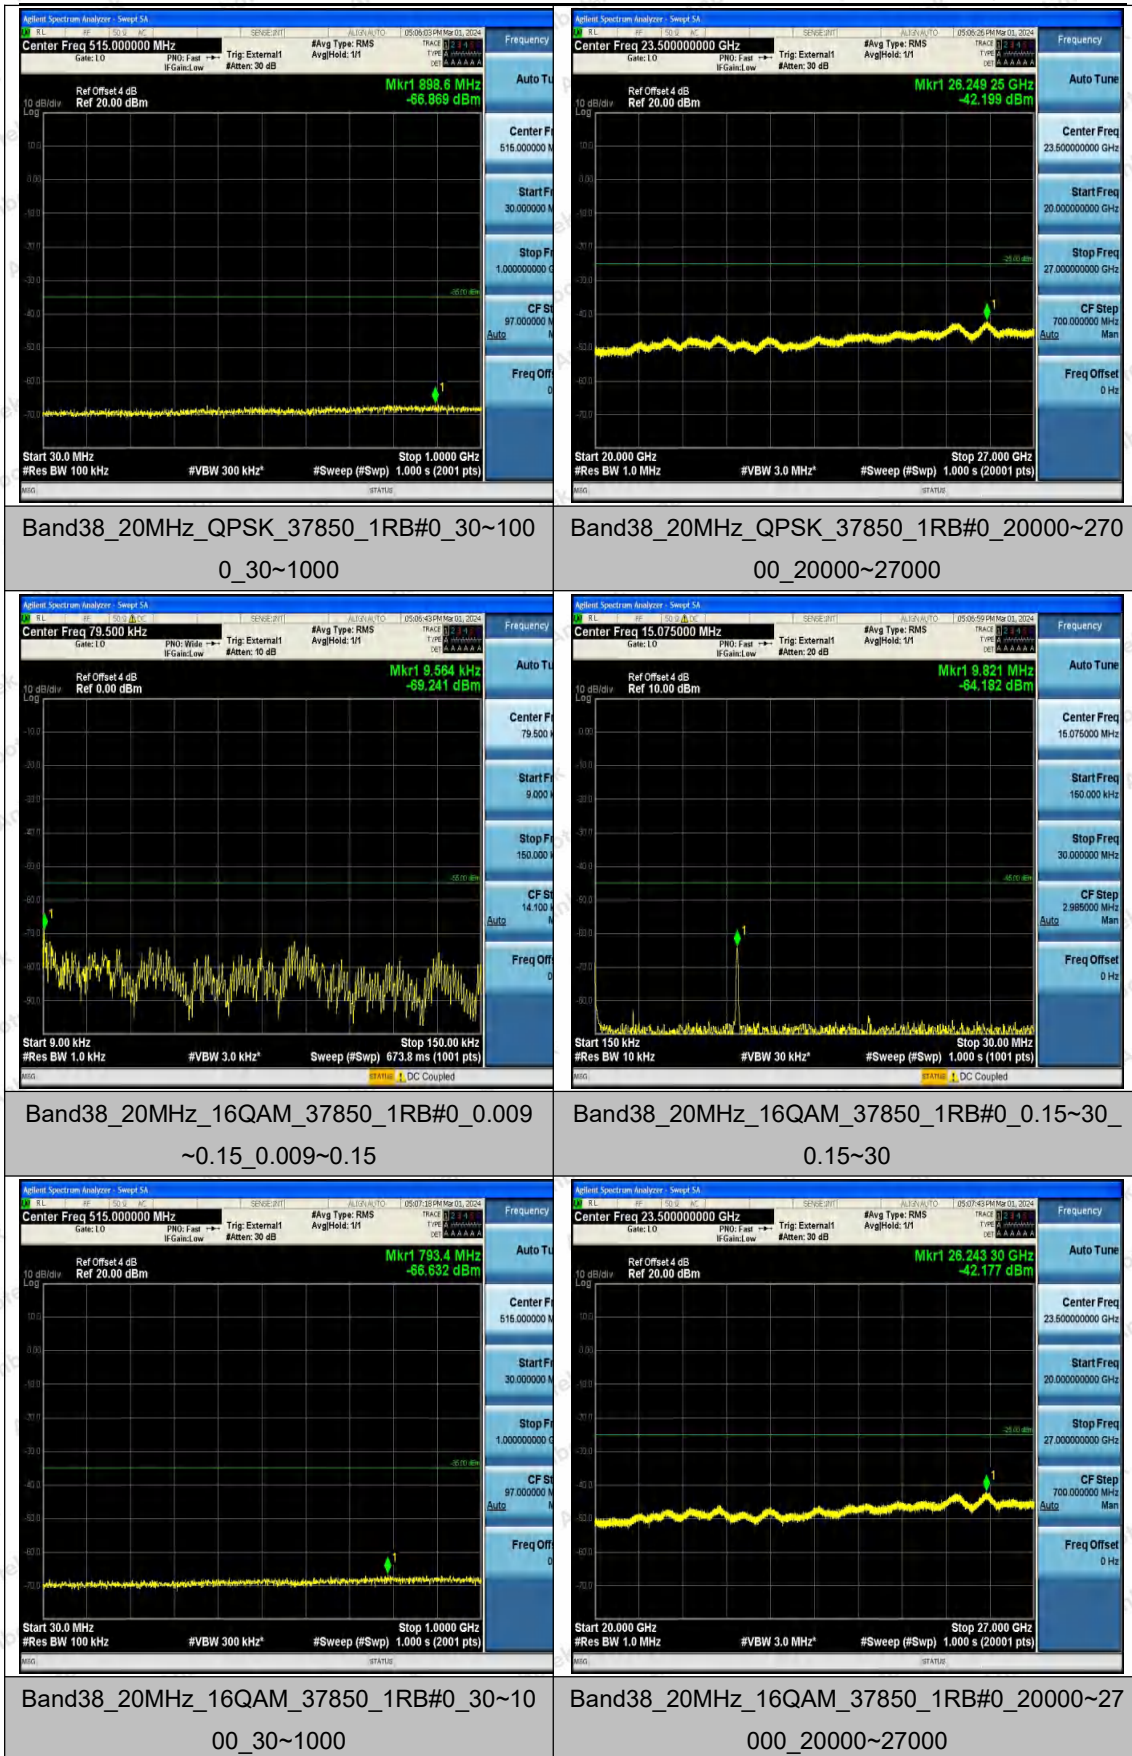


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



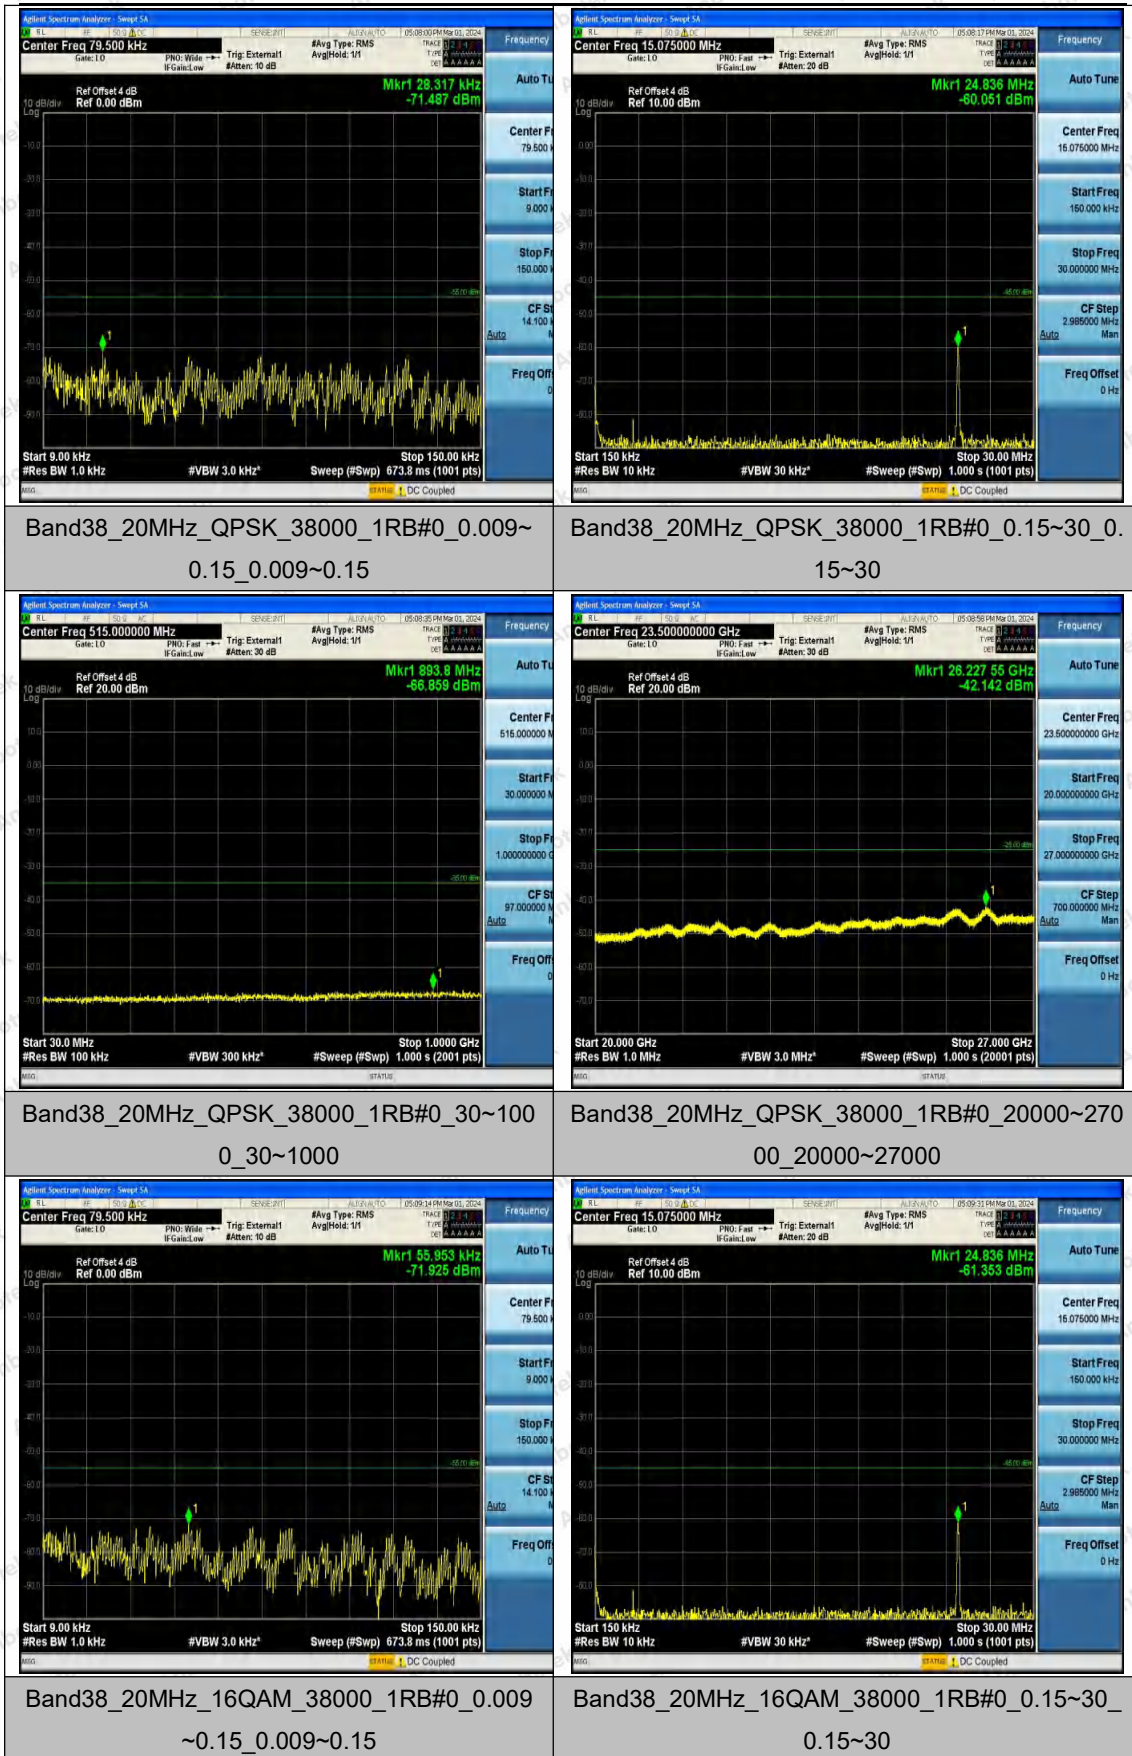

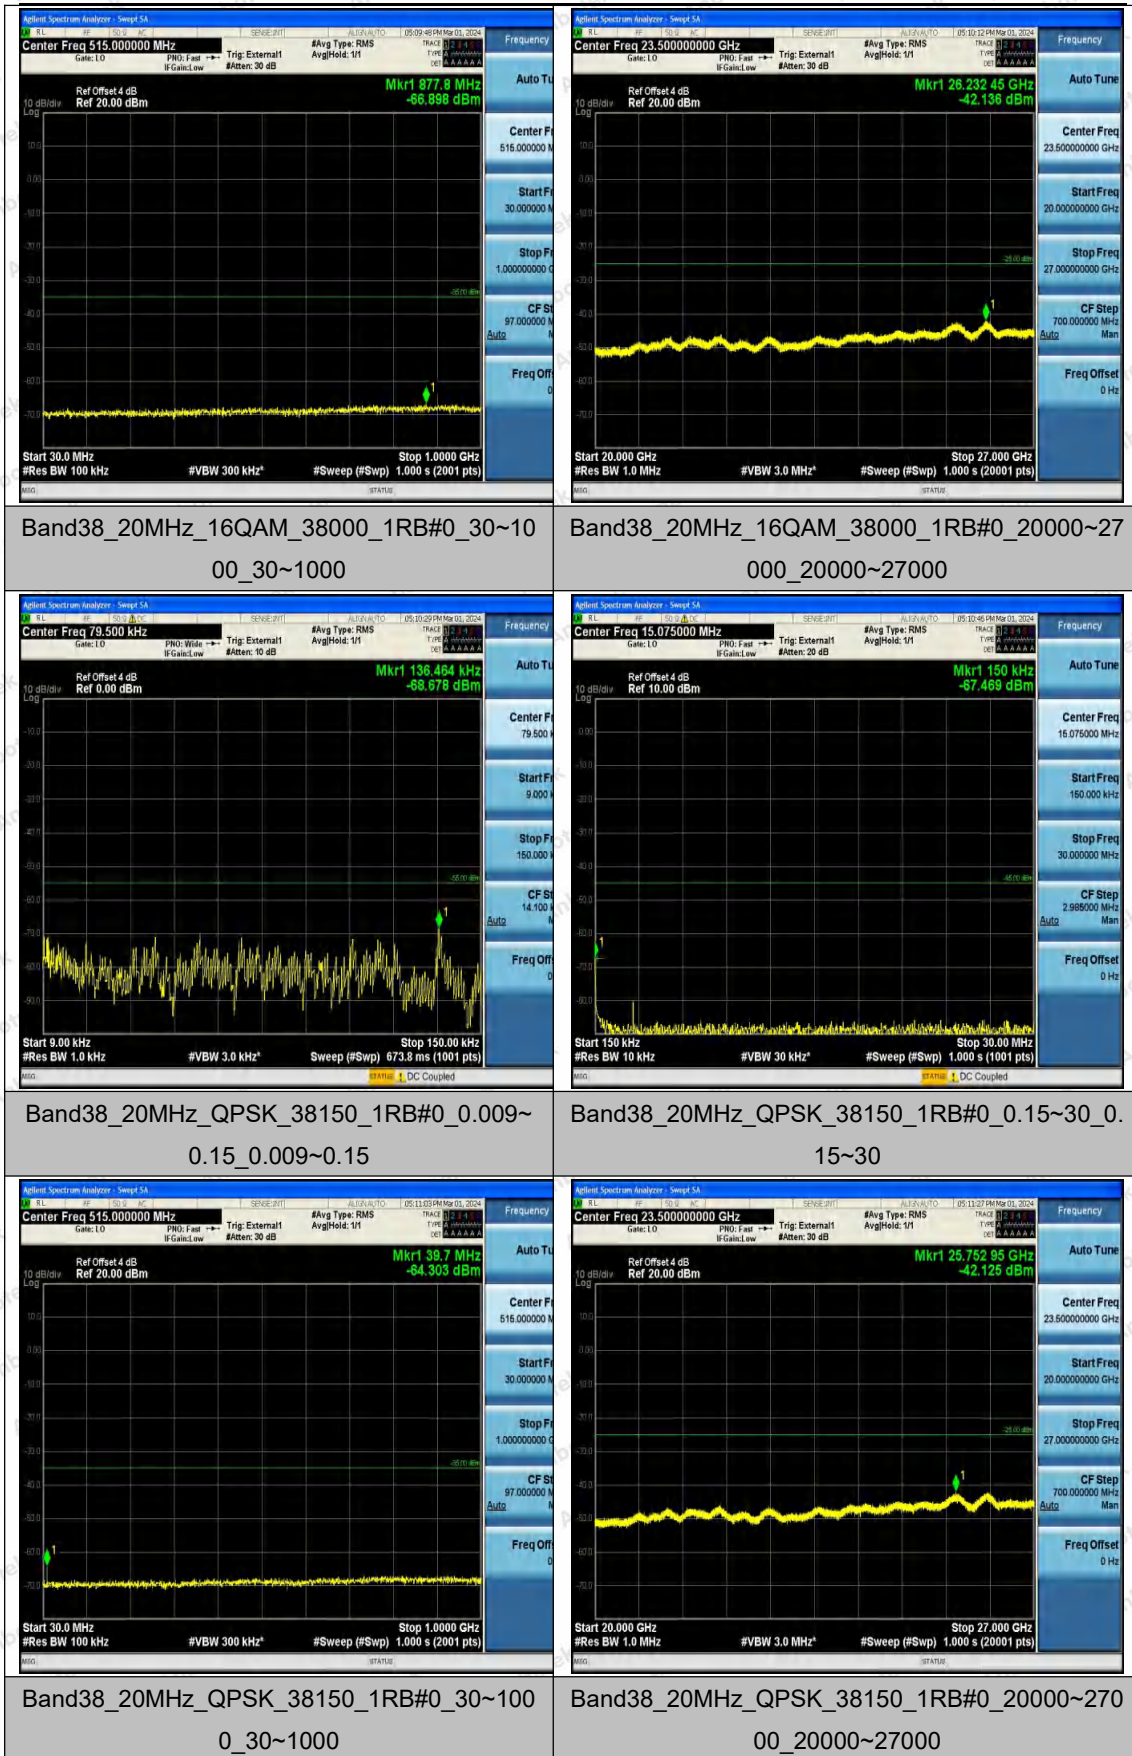


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



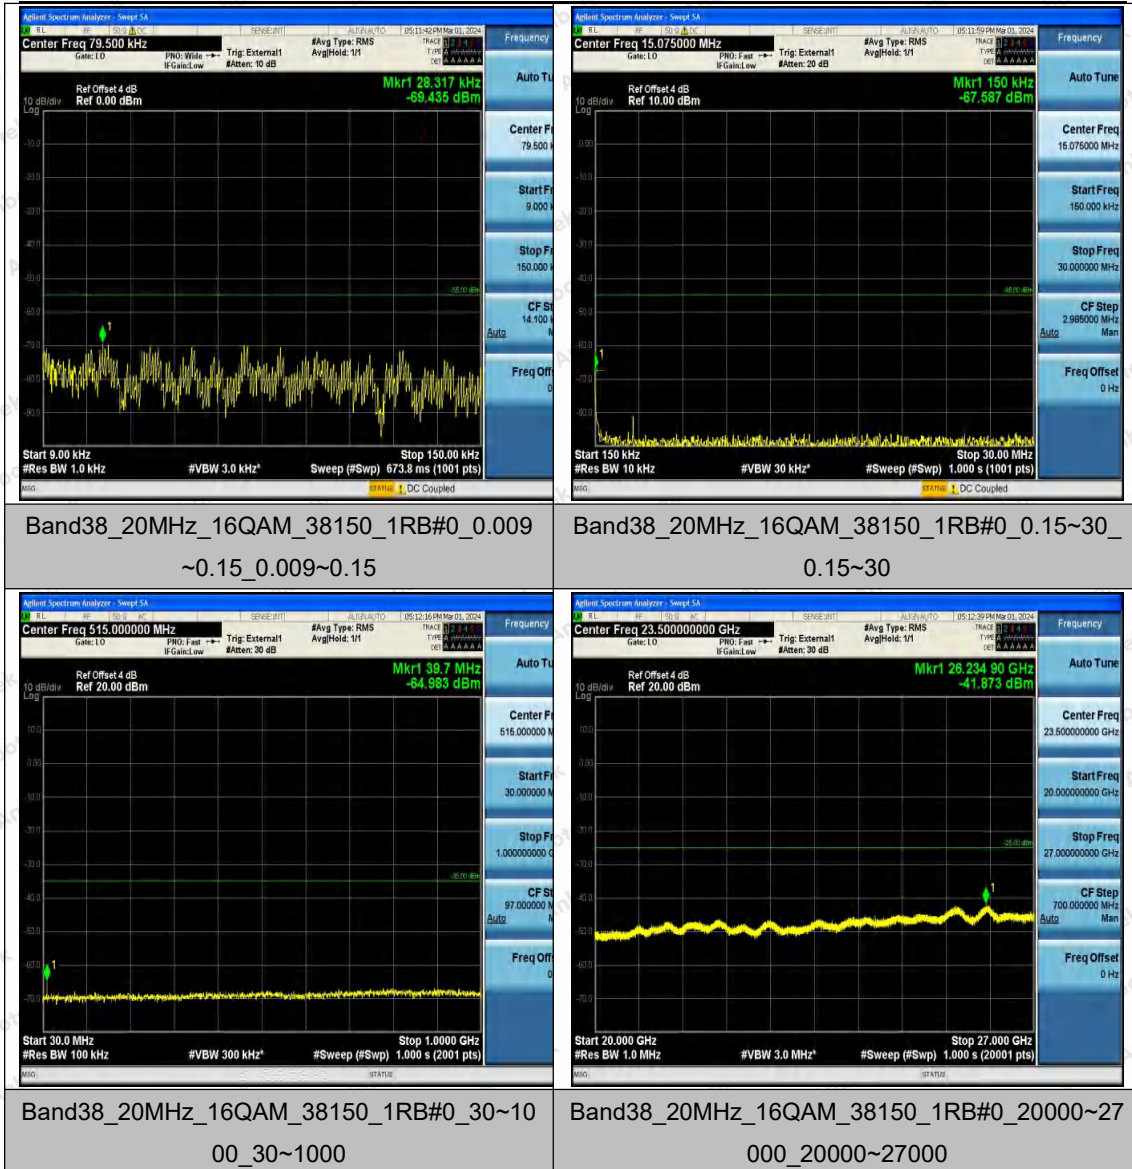

Band38_20MHz_16QAM_38150_1RB#0_0.009
~0.15_0.009~0.15

Band38_20MHz_16QAM_38150_1RB#0_0.15~30_
0.15~30

Band38_20MHz_16QAM_38150_1RB#0_30~10
00_30~1000

Band38_20MHz_16QAM_38150_1RB#0_20000~27
000_20000~27000



Appendix F: Frequency Stability

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage		Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
					Voltage [Vdc]	Temperature (°C)				
Band38	5MHz	QPSK	37775	25RB#0	VN	NT	-5.69	-0.002212	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VL	NT	5.35	0.002080	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	VH	NT	-5.95	-0.002313	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VN	NT	7.87	0.003059	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VL	NT	-3.28	-0.001275	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	VH	NT	-4.21	-0.001637	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VN	NT	-3.86	-0.001487	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VL	NT	5.87	0.002262	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	VH	NT	-5.98	-0.002304	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VN	NT	3.05	0.001175	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VL	NT	-8.93	-0.003441	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	VH	NT	-10.67	-0.004112	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VN	NT	-8.23	-0.003144	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VL	NT	-5.44	-0.002078	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	VH	NT	8.88	0.003393	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VN	NT	-8.65	-0.003305	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VL	NT	7.87	0.003007	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	VH	NT	-5.36	-0.002048	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VN	NT	-4.62	-0.001794	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VL	NT	6.97	0.002707	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	VH	NT	5.25	0.002039	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VN	NT	9.10	0.003534	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VL	NT	12.17	0.004726	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	VH	NT	5.25	0.002039	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VN	NT	4.96	0.001911	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VL	NT	6.85	0.002640	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	VH	NT	-9.97	-0.003842	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VN	NT	-8.31	-0.003202	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VL	NT	-6.85	-0.002640	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	VH	NT	-7.05	-0.002717	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VN	NT	-9.30	-0.003556	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VL	NT	8.30	0.003174	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	VH	NT	11.37	0.004348	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VN	NT	6.77	0.002589	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	VL	NT	-5.29	-0.002023	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	10MHz	16QAM	38200	50RB#0	VH	NT	4.78	0.001828	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VN	NT	8.14	0.003158	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VL	NT	8.51	0.003302	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	VH	NT	5.98	0.002320	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VN	NT	8.18	0.003174	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VL	NT	5.55	0.002153	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	VH	NT	10.31	0.004000	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VN	NT	-5.97	-0.002301	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VL	NT	4.73	0.001823	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	VH	NT	-8.61	-0.003318	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VN	NT	-9.14	-0.003522	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VL	NT	-10.26	-0.003954	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	VH	NT	-8.03	-0.003094	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VN	NT	8.27	0.003166	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VL	NT	12.12	0.004639	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	VH	NT	11.46	0.004387	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VN	NT	10.87	0.004161	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VL	NT	7.88	0.003016	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	VH	NT	9.47	0.003625	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VN	NT	-8.45	-0.003275	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VL	NT	-10.33	-0.004004	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	VH	NT	-6.79	-0.002632	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VN	NT	-9.28	-0.003597	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VL	NT	-4.48	-0.001736	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	VH	NT	-7.82	-0.003031	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VN	NT	6.12	0.002358	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VL	NT	11.46	0.004416	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	VH	NT	6.18	0.002382	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VN	NT	-7.22	-0.002782	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VL	NT	6.05	0.002331	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	VH	NT	-11.90	-0.004586	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VN	NT	5.06	0.001939	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VL	NT	-9.41	-0.003605	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	VH	NT	-5.92	-0.002268	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VN	NT	-8.87	-0.003398	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VL	NT	6.54	0.002506	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	VH	NT	5.38	0.002061	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configuration	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Band38	5MHz	QPSK	37775	25RB#0	NV	-30	-5.78	-0.002247	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-20	-7.35	-0.002857	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	-10	-4.61	-0.001792	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	0	8.35	0.003246	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	10	-8.65	-0.003362	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	20	-8.44	-0.003281	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	30	-11.16	-0.004338	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	40	-11.04	-0.004292	±2.5	PASS
Band38	5MHz	QPSK	37775	25RB#0	NV	50	-8.55	-0.003324	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-30	-9.16	-0.003561	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-20	-8.44	-0.003281	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	-10	9.87	0.003837	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	0	10.20	0.003965	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	10	6.97	0.002709	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	20	10.80	0.004198	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	30	5.52	0.002146	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	40	-9.17	-0.003565	±2.5	PASS
Band38	5MHz	16QAM	37775	25RB#0	NV	50	10.47	0.004070	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-30	9.60	0.003699	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-20	-10.16	-0.003915	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	-10	-5.51	-0.002123	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	0	4.16	0.001603	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	10	6.94	0.002674	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	20	5.45	0.002100	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	30	7.57	0.002917	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	40	7.93	0.003056	±2.5	PASS
Band38	5MHz	QPSK	38000	25RB#0	NV	50	-8.14	-0.003137	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-30	-13.63	-0.005252	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-20	4.25	0.001638	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	-10	-5.87	-0.002262	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	0	-7.71	-0.002971	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	10	-6.72	-0.002590	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	20	5.56	0.002143	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	30	-9.58	-0.003692	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	40	10.84	0.004177	±2.5	PASS
Band38	5MHz	16QAM	38000	25RB#0	NV	50	-7.52	-0.002898	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-30	11.39	0.004351	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-20	-5.95	-0.002273	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	-10	-5.12	-0.001956	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	0	5.71	0.002181	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	10	-5.88	-0.002246	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band38	5MHz	QPSK	38225	25RB#0	NV	20	5.65	0.002159	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	30	-5.98	-0.002285	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	40	4.13	0.001578	±2.5	PASS
Band38	5MHz	QPSK	38225	25RB#0	NV	50	11.46	0.004378	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-30	-7.84	-0.002995	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-20	6.58	0.002514	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	-10	-6.07	-0.002319	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	0	11.34	0.004332	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	10	-9.54	-0.003645	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	20	7.50	0.002865	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	30	10.04	0.003836	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	40	-10.93	-0.004176	±2.5	PASS
Band38	5MHz	16QAM	38225	25RB#0	NV	50	-6.28	-0.002399	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-30	-8.75	-0.003398	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-20	6.57	0.002551	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	-10	7.12	0.002765	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	0	-7.21	-0.002800	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	10	5.94	0.002307	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	20	-5.69	-0.002210	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	30	10.09	0.003918	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	40	6.02	0.002338	±2.5	PASS
Band38	10MHz	QPSK	37800	50RB#0	NV	50	8.37	0.003250	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-30	7.35	0.002854	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-20	8.88	0.003449	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	-10	12.63	0.004905	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	0	8.55	0.003320	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	10	11.39	0.004423	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	20	7.35	0.002854	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	30	5.85	0.002272	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	40	7.81	0.003033	±2.5	PASS
Band38	10MHz	16QAM	37800	50RB#0	NV	50	8.37	0.003250	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-30	-11.90	-0.004586	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-20	-9.16	-0.003530	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	-10	-12.25	-0.004721	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	0	-6.71	-0.002586	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	10	-8.93	-0.003441	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	20	-11.13	-0.004289	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	30	-10.01	-0.003857	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	40	-9.53	-0.003672	±2.5	PASS
Band38	10MHz	QPSK	38000	50RB#0	NV	50	-8.68	-0.003345	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-30	-10.47	-0.004035	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	10MHz	16QAM	38000	50RB#0	NV	-20	-9.81	-0.003780	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	-10	-10.66	-0.004108	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	0	-9.46	-0.003645	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	10	-13.16	-0.005071	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	20	-14.75	-0.005684	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	30	-10.59	-0.004081	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	40	-9.98	-0.003846	±2.5	PASS
Band38	10MHz	16QAM	38000	50RB#0	NV	50	-10.96	-0.004224	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-30	-10.19	-0.003897	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-20	8.20	0.003136	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	-10	5.44	0.002080	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	0	-7.32	-0.002799	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	10	6.57	0.002512	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	20	5.79	0.002214	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	30	-7.18	-0.002746	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	40	5.12	0.001958	±2.5	PASS
Band38	10MHz	QPSK	38200	50RB#0	NV	50	10.23	0.003912	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-30	13.33	0.005098	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-20	-6.17	-0.002359	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	-10	12.60	0.004818	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	0	10.46	0.004000	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	10	8.11	0.003101	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	20	8.34	0.003189	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	30	11.56	0.004421	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	40	8.37	0.003201	±2.5	PASS
Band38	10MHz	16QAM	38200	50RB#0	NV	50	8.23	0.003147	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-30	4.13	0.001602	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-20	-8.97	-0.003480	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	-10	10.51	0.004078	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	0	-4.58	-0.001777	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	10	-6.08	-0.002359	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	20	5.65	0.002192	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	30	-3.30	-0.001280	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	40	10.03	0.003891	±2.5	PASS
Band38	15MHz	QPSK	37825	75RB#0	NV	50	10.07	0.003907	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-30	7.10	0.002755	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-20	11.40	0.004423	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	-10	7.52	0.002918	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	0	7.68	0.002980	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	10	8.91	0.003457	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	20	-9.34	-0.003624	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



Band38	15MHz	16QAM	37825	75RB#0	NV	30	3.19	0.001238	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	40	9.58	0.003717	±2.5	PASS
Band38	15MHz	16QAM	37825	75RB#0	NV	50	7.02	0.002724	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-30	5.32	0.002050	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-20	-6.72	-0.002590	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	-10	-17.17	-0.006617	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	0	-6.22	-0.002397	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	10	-10.41	-0.004012	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	20	-7.10	-0.002736	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	30	-9.53	-0.003672	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	40	5.85	0.002254	±2.5	PASS
Band38	15MHz	QPSK	38000	75RB#0	NV	50	9.97	0.003842	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-30	-5.12	-0.001973	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-20	4.31	0.001661	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	-10	-5.66	-0.002181	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	0	-5.51	-0.002123	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	10	-4.19	-0.001615	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	20	5.25	0.002023	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	30	-9.67	-0.003726	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	40	-10.30	-0.003969	±2.5	PASS
Band38	15MHz	16QAM	38000	75RB#0	NV	50	-6.51	-0.002509	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-30	11.42	0.004371	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-20	6.79	0.002599	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	-10	12.50	0.004785	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	0	11.12	0.004256	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	10	4.69	0.001795	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	20	10.00	0.003828	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	30	5.28	0.002021	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	40	9.36	0.003583	±2.5	PASS
Band38	15MHz	QPSK	38175	75RB#0	NV	50	4.75	0.001818	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-30	11.80	0.004517	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-20	9.28	0.003552	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	-10	5.52	0.002113	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	0	6.24	0.002389	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	10	13.53	0.005179	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	20	5.78	0.002212	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	30	8.35	0.003196	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	40	10.00	0.003828	±2.5	PASS
Band38	15MHz	16QAM	38175	75RB#0	NV	50	16.31	0.006243	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-30	-10.51	-0.004074	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	-20	-9.74	-0.003775	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band38	20MHz	QPSK	37850	100RB#0	NV	-10	-6.45	-0.002500	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	0	-9.04	-0.003504	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	10	-6.79	-0.002632	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	20	-8.73	-0.003384	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	30	-9.10	-0.003527	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	40	-12.27	-0.004756	±2.5	PASS
Band38	20MHz	QPSK	37850	100RB#0	NV	50	-4.05	-0.001570	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-30	-5.72	-0.002217	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-20	-12.95	-0.005019	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	-10	-4.46	-0.001729	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	0	-4.49	-0.001740	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	10	-11.09	-0.004298	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	20	-9.84	-0.003814	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	30	-9.00	-0.003488	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	40	-7.40	-0.002868	±2.5	PASS
Band38	20MHz	16QAM	37850	100RB#0	NV	50	-6.21	-0.002407	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-30	-6.21	-0.002393	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-20	7.95	0.003064	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	-10	7.01	0.002701	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	0	-5.97	-0.002301	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	10	9.91	0.003819	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	20	-8.87	-0.003418	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	30	5.79	0.002231	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	40	-6.28	-0.002420	±2.5	PASS
Band38	20MHz	QPSK	38000	100RB#0	NV	50	-5.92	-0.002281	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-30	-6.11	-0.002355	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-20	-7.18	-0.002767	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	-10	6.71	0.002586	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	0	-7.91	-0.003048	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	10	-7.71	-0.002971	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	20	-4.59	-0.001769	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	30	-13.25	-0.005106	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	40	-6.31	-0.002432	±2.5	PASS
Band38	20MHz	16QAM	38000	100RB#0	NV	50	6.69	0.002578	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-30	-7.98	-0.003057	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-20	-7.44	-0.002851	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	-10	-7.98	-0.003057	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	0	-8.25	-0.003161	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	10	-4.51	-0.001728	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	20	-8.77	-0.003360	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	30	4.82	0.001847	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline

400-003-0500

www.anbotek.com.cn



Band38	20MHz	QPSK	38150	100RB#0	NV	40	-6.42	-0.002460	±2.5	PASS
Band38	20MHz	QPSK	38150	100RB#0	NV	50	7.21	0.002762	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-30	-9.83	-0.003766	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-20	-4.35	-0.001667	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	-10	6.02	0.002307	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	0	6.02	0.002307	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	10	6.27	0.002402	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	20	-7.20	-0.002759	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	30	-6.11	-0.002341	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	40	-8.18	-0.003134	±2.5	PASS
Band38	20MHz	16QAM	38150	100RB#0	NV	50	-9.81	-0.003759	±2.5	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn

