

Appendix Test Data

Report No.:	1812C50125512504	Test Sample No.:	1-2-2
Start Test Date:	2025-05-12	Finish Test Date:	2025-05-12
Test Engineer:	<i>Alex Peng</i>	Auditor:	<i>Justin Feng</i>
Temperature:	25°C	Relative Humidity:	56%
Pressure:	101kPa		

Appendix A1: 26dB Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	26db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	20.440	5169.800	5190.240	---	---
11A	Ant1	5220	20.760	5209.640	5230.400	---	---
11A	Ant1	5240	20.400	5229.840	5250.240	---	---
11A	Ant1	5745	20.560	5734.680	5755.240	---	---
11A	Ant1	5785	20.480	5774.800	5795.280	---	---
11A	Ant1	5825	20.600	5814.800	5835.400	---	---
11N20SISO	Ant1	5180	20.800	5169.640	5190.440	---	---
11N20SISO	Ant1	5220	20.880	5209.640	5230.520	---	---
11N20SISO	Ant1	5240	20.720	5229.640	5250.360	---	---
11N20SISO	Ant1	5745	20.800	5734.640	5755.440	---	---
11N20SISO	Ant1	5785	20.920	5774.600	5795.520	---	---
11N20SISO	Ant1	5825	21.040	5814.480	5835.520	---	---
11N40SISO	Ant1	5190	43.360	5168.080	5211.440	---	---
11N40SISO	Ant1	5230	42.960	5208.480	5251.440	---	---
11N40SISO	Ant1	5755	43.040	5733.720	5776.760	---	---
11N40SISO	Ant1	5795	43.440	5773.560	5817.000	---	---
11AC20SISO	Ant1	5180	20.680	5169.760	5190.440	---	---
11AC20SISO	Ant1	5220	20.960	5209.520	5230.480	---	---
11AC20SISO	Ant1	5240	20.880	5229.640	5250.520	---	---
11AC20SISO	Ant1	5745	21.080	5734.600	5755.680	---	---
11AC20SISO	Ant1	5785	20.880	5774.560	5795.440	---	---
11AC20SISO	Ant1	5825	20.960	5814.560	5835.520	---	---

11AC40SISO	Ant1	5190	42.000	5169.360	5211.360	---	---
11AC40SISO	Ant1	5230	42.960	5208.960	5251.920	---	---
11AC40SISO	Ant1	5755	43.120	5733.720	5776.840	---	---
11AC40SISO	Ant1	5795	42.000	5774.200	5816.200	---	---
11AC80SISO	Ant1	5210	81.920	5169.200	5251.120	---	---
11AC80SISO	Ant1	5775	83.360	5733.080	5816.440	---	---


Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel:(86)0755-26066440 Email:service@anbotek.com





Hotline
400-003-0500
www.anbotek.com

Test Graphs

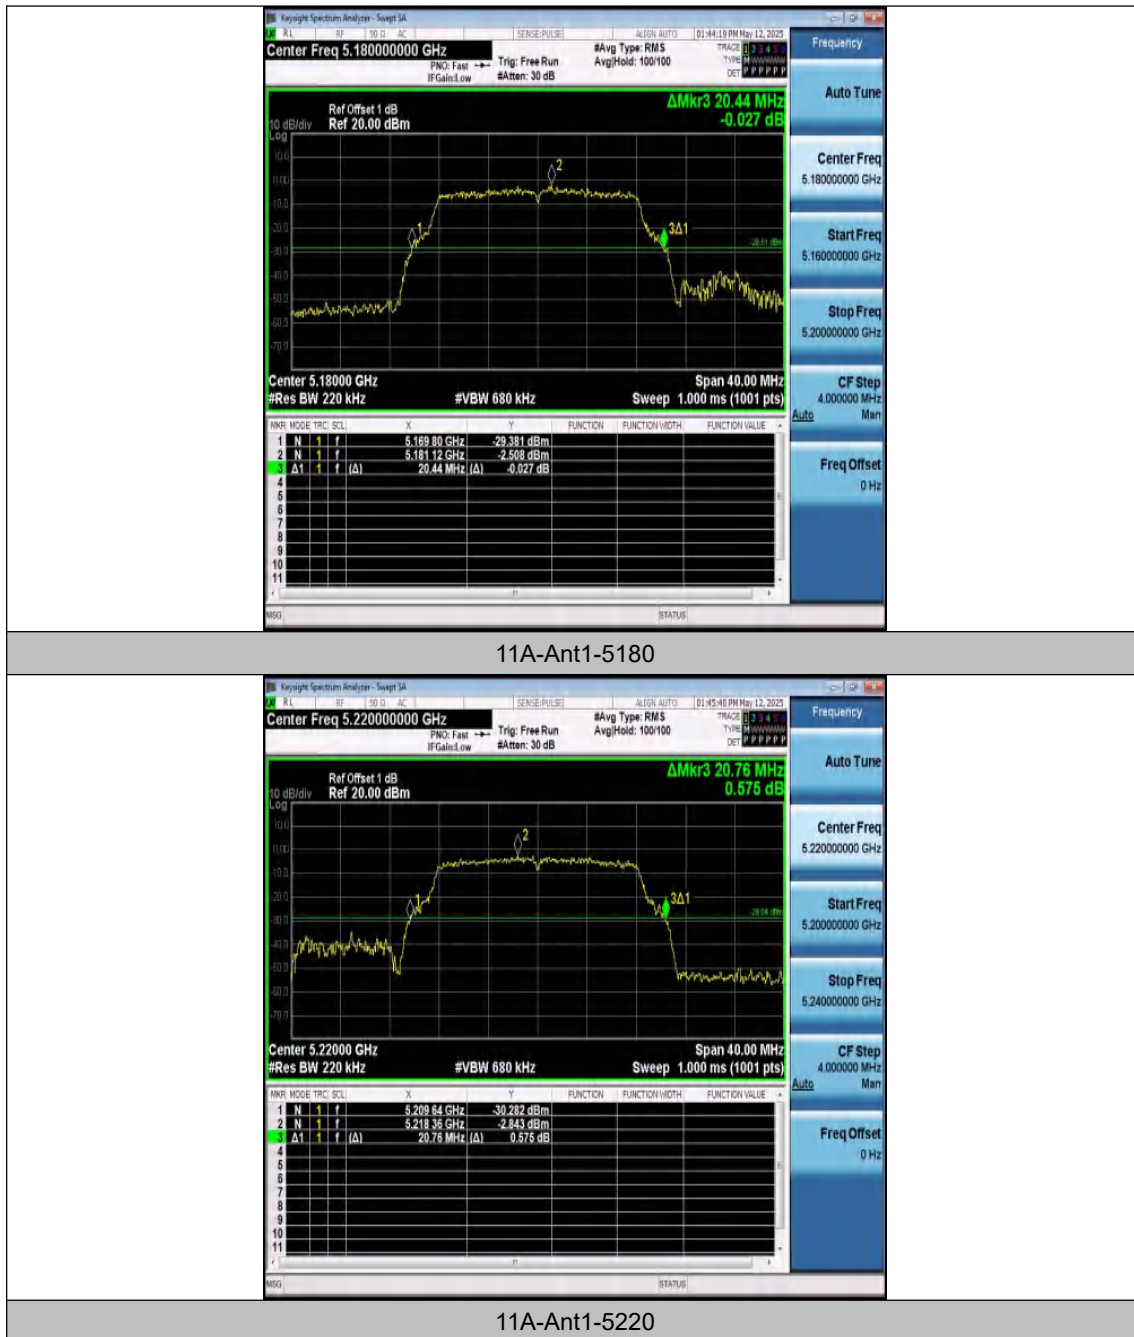

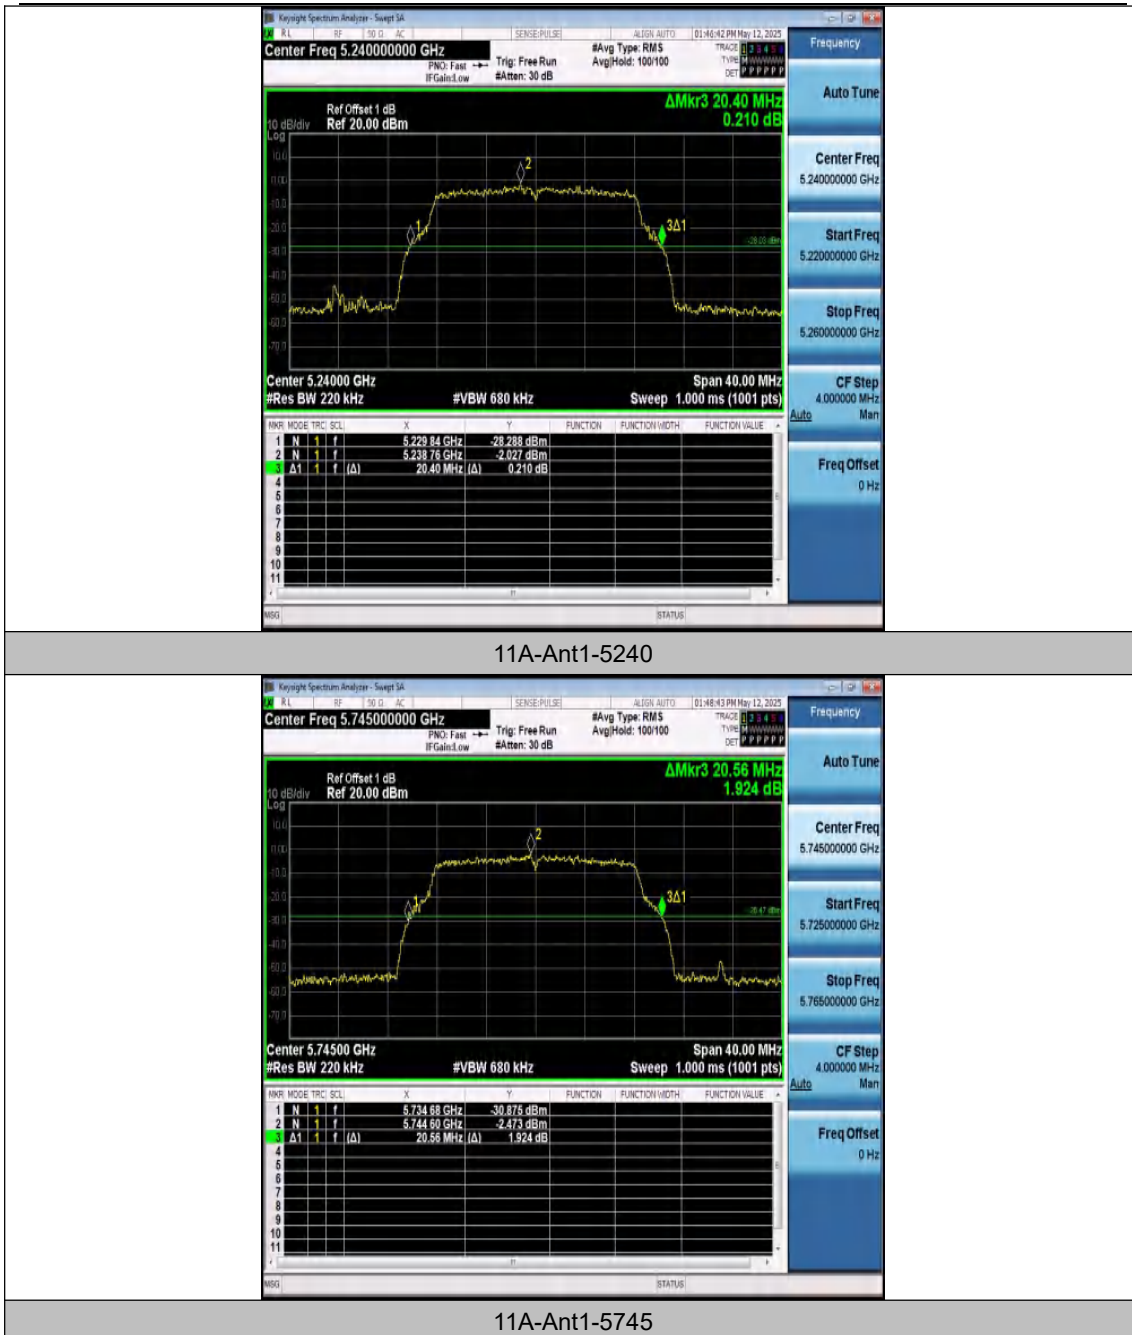

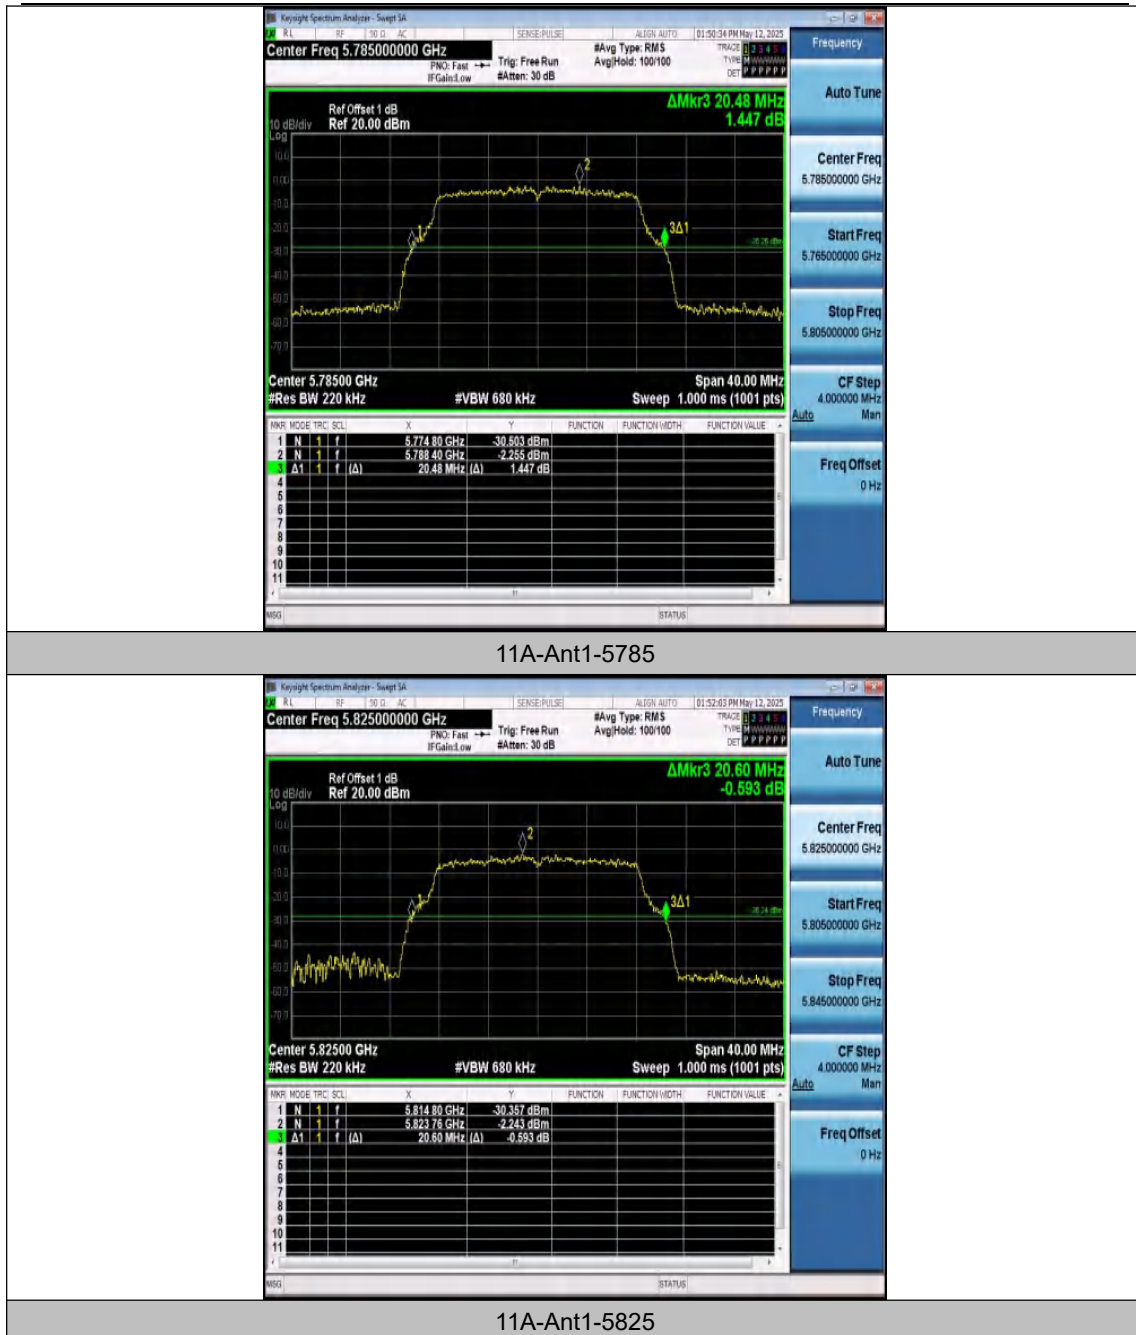

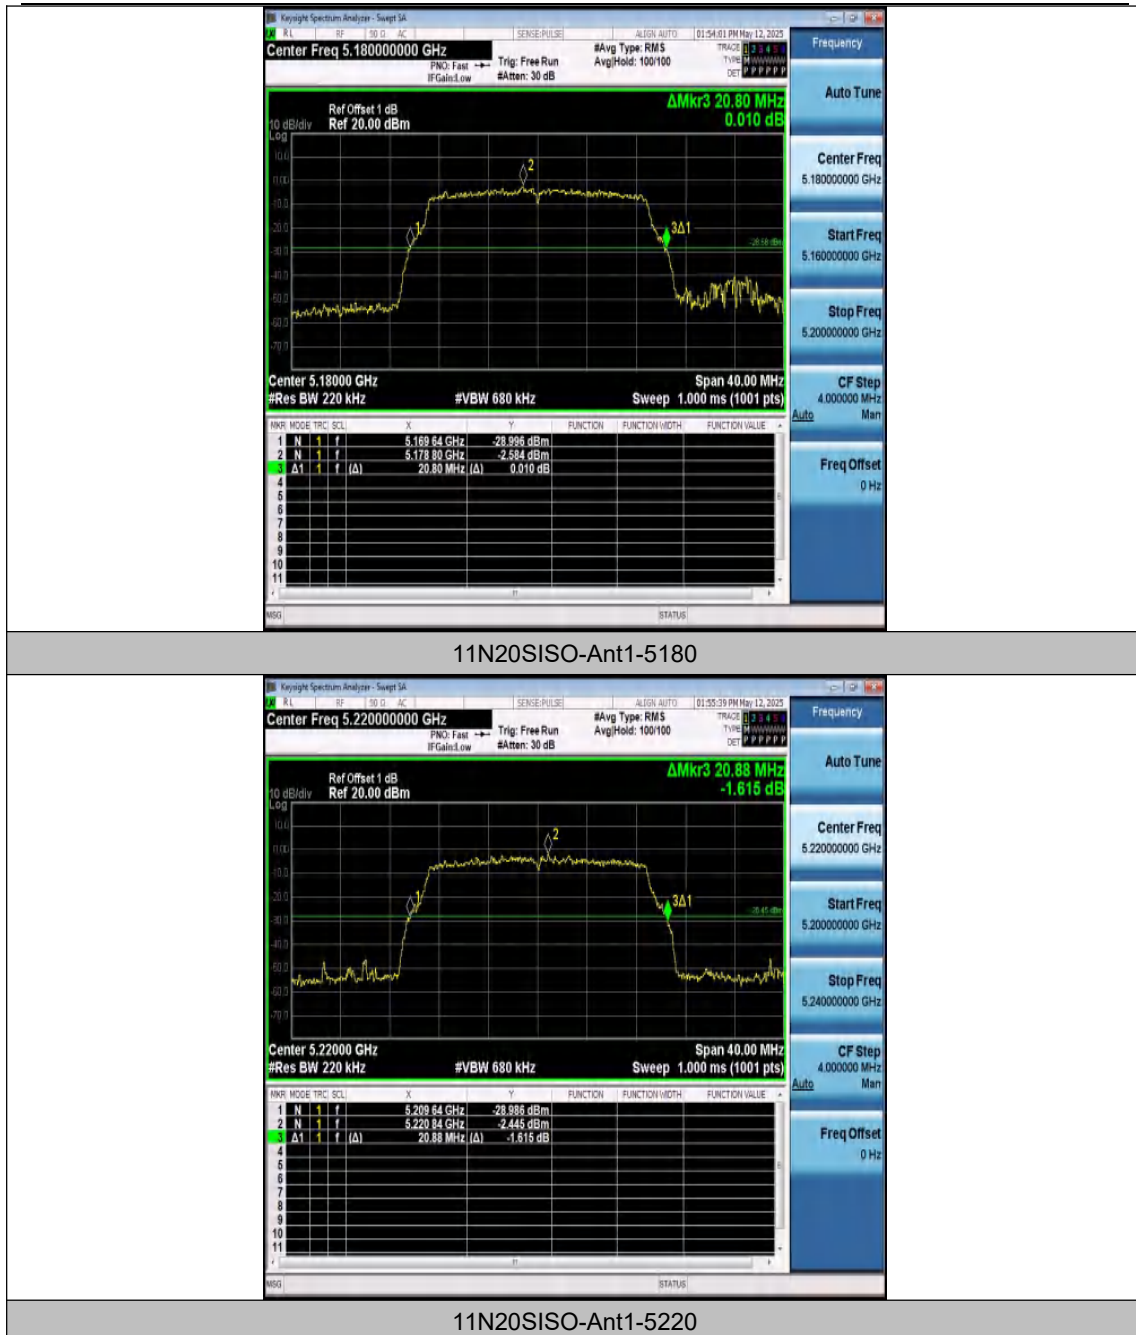



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

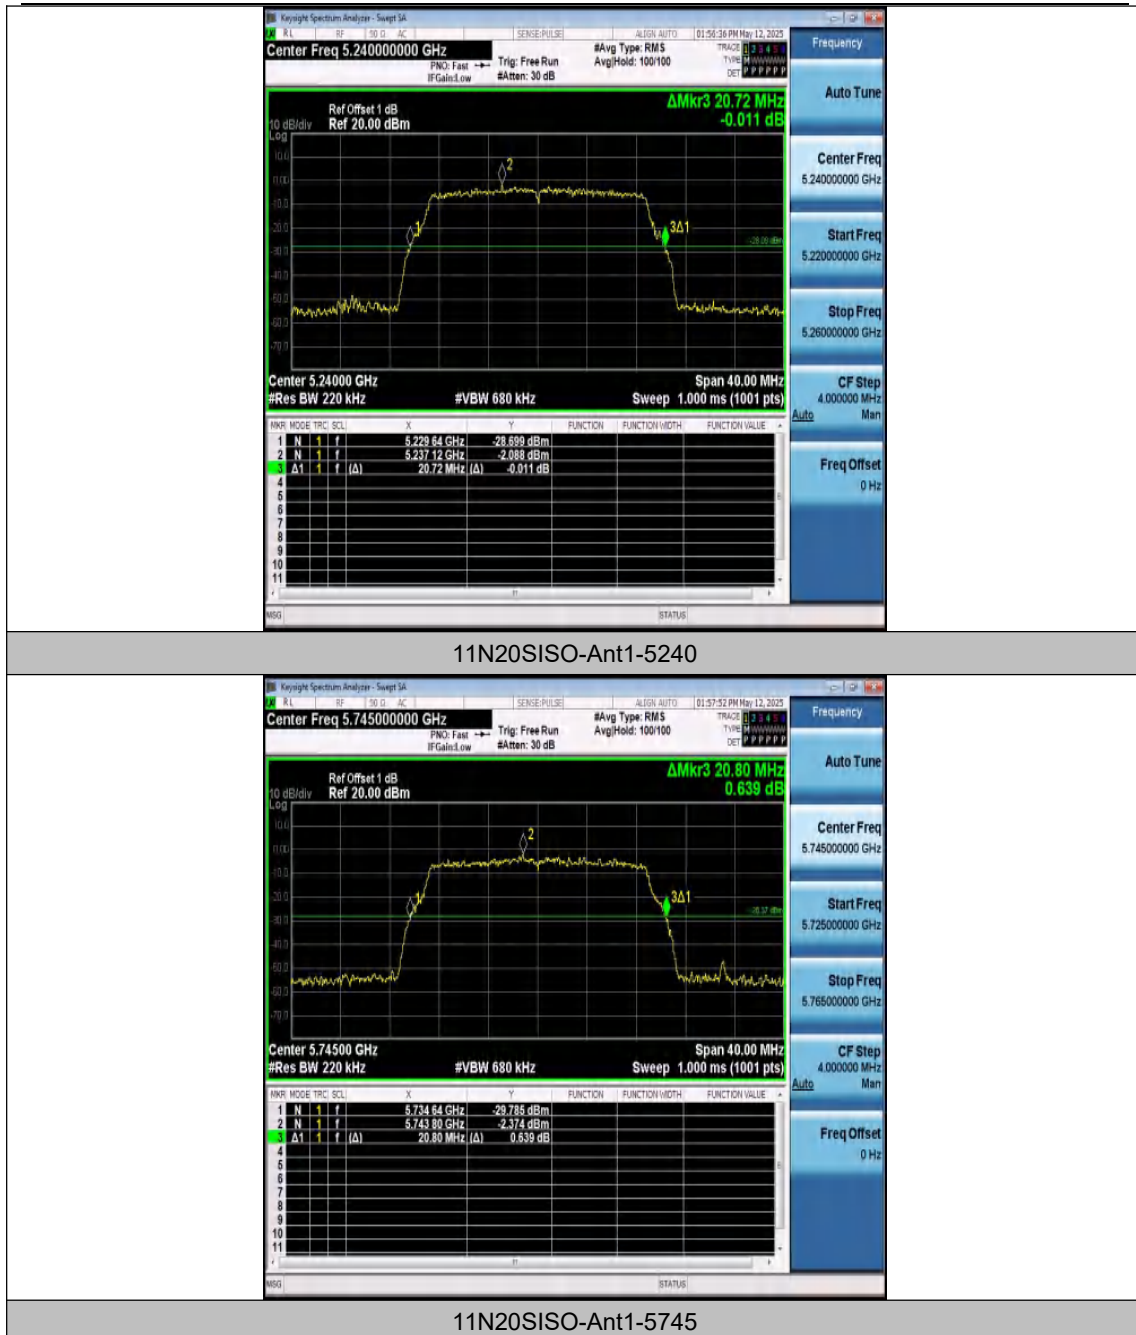


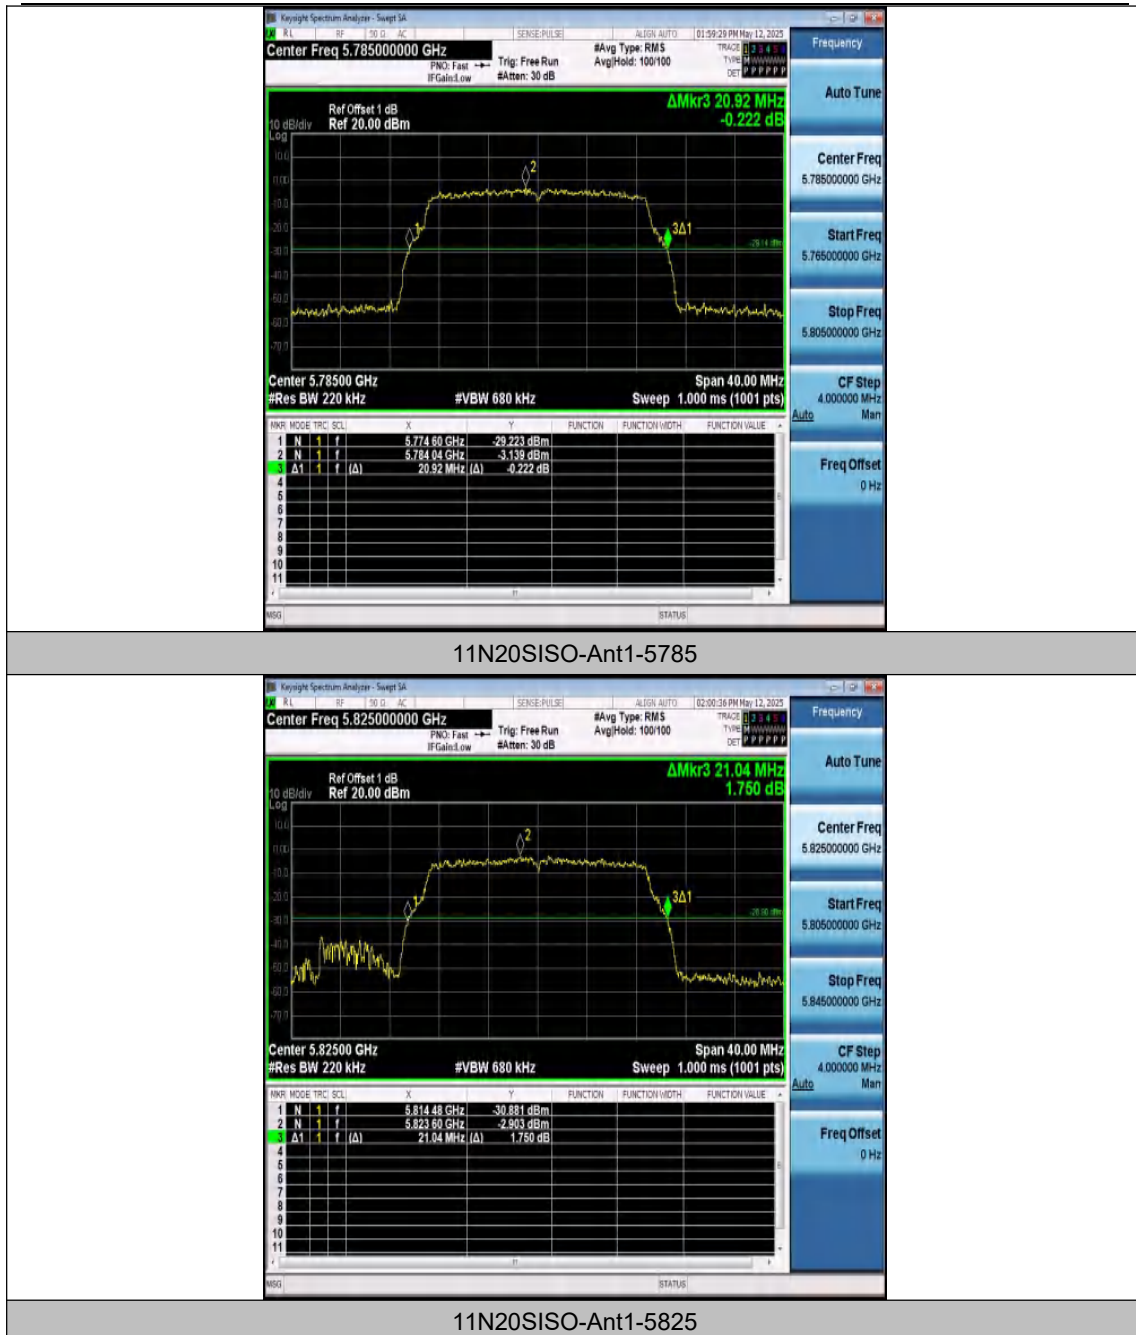


Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

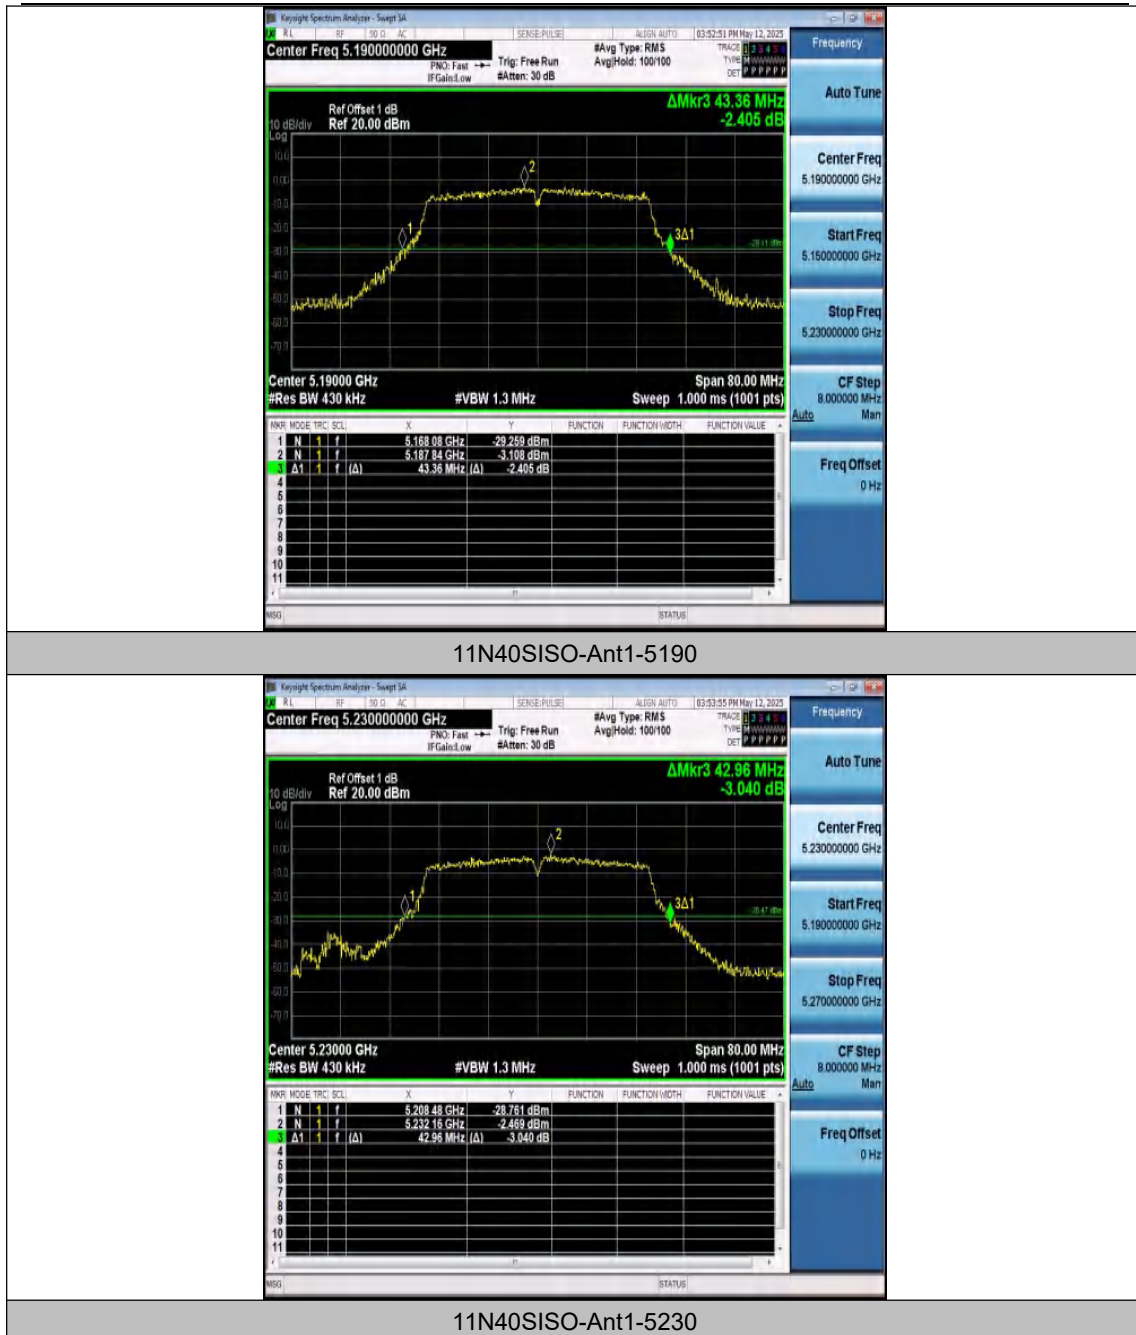

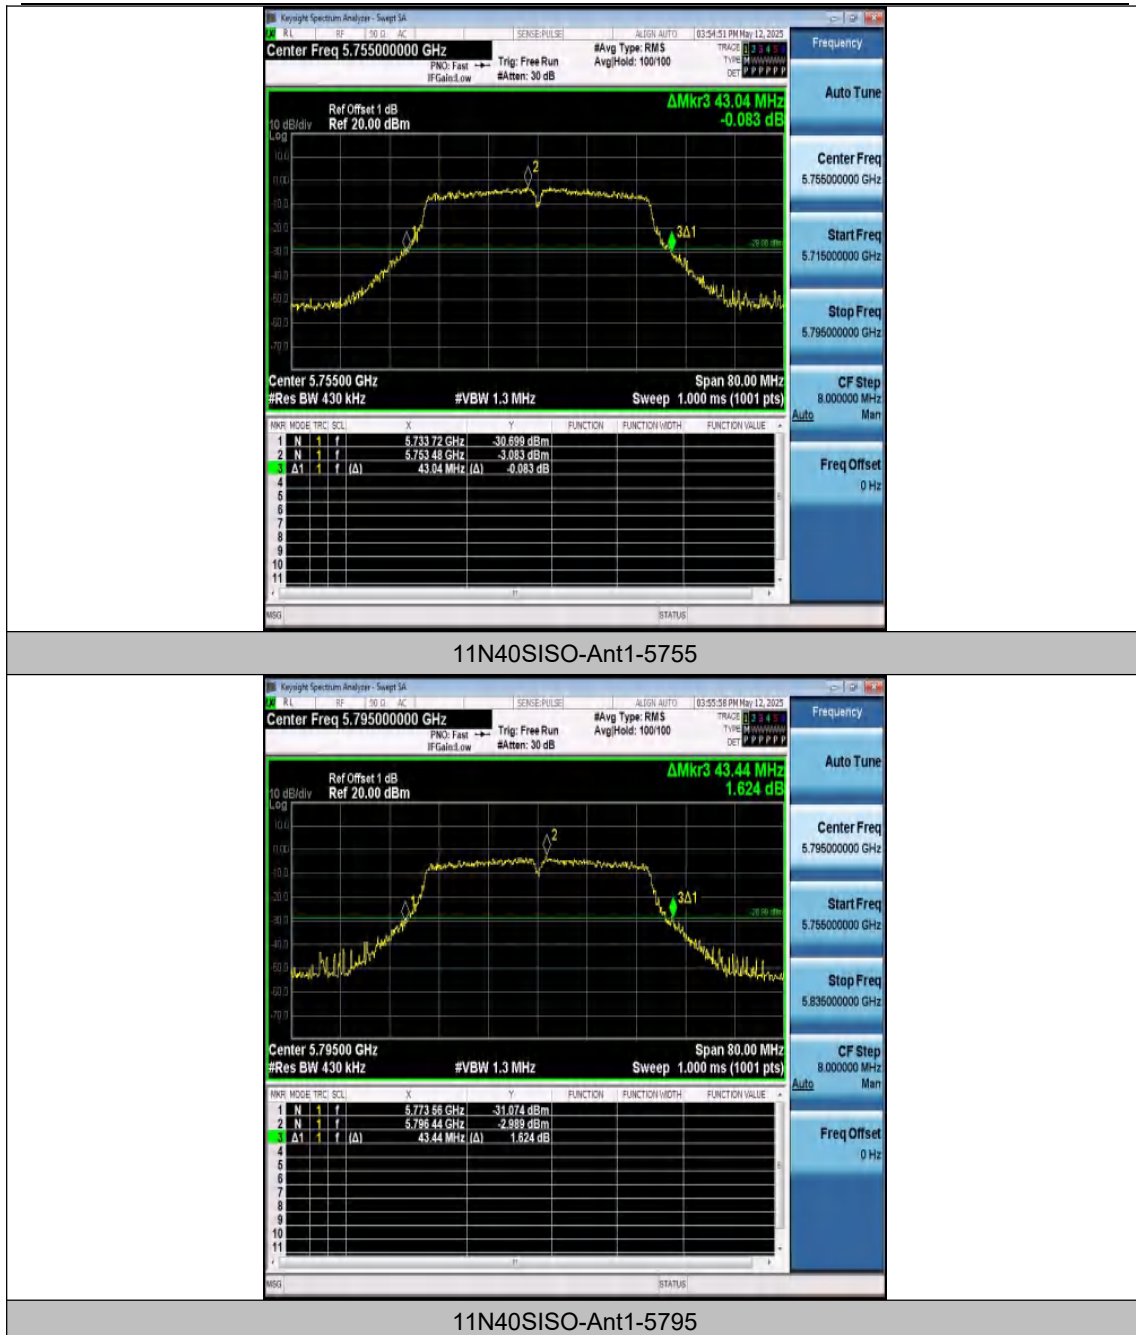



Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com



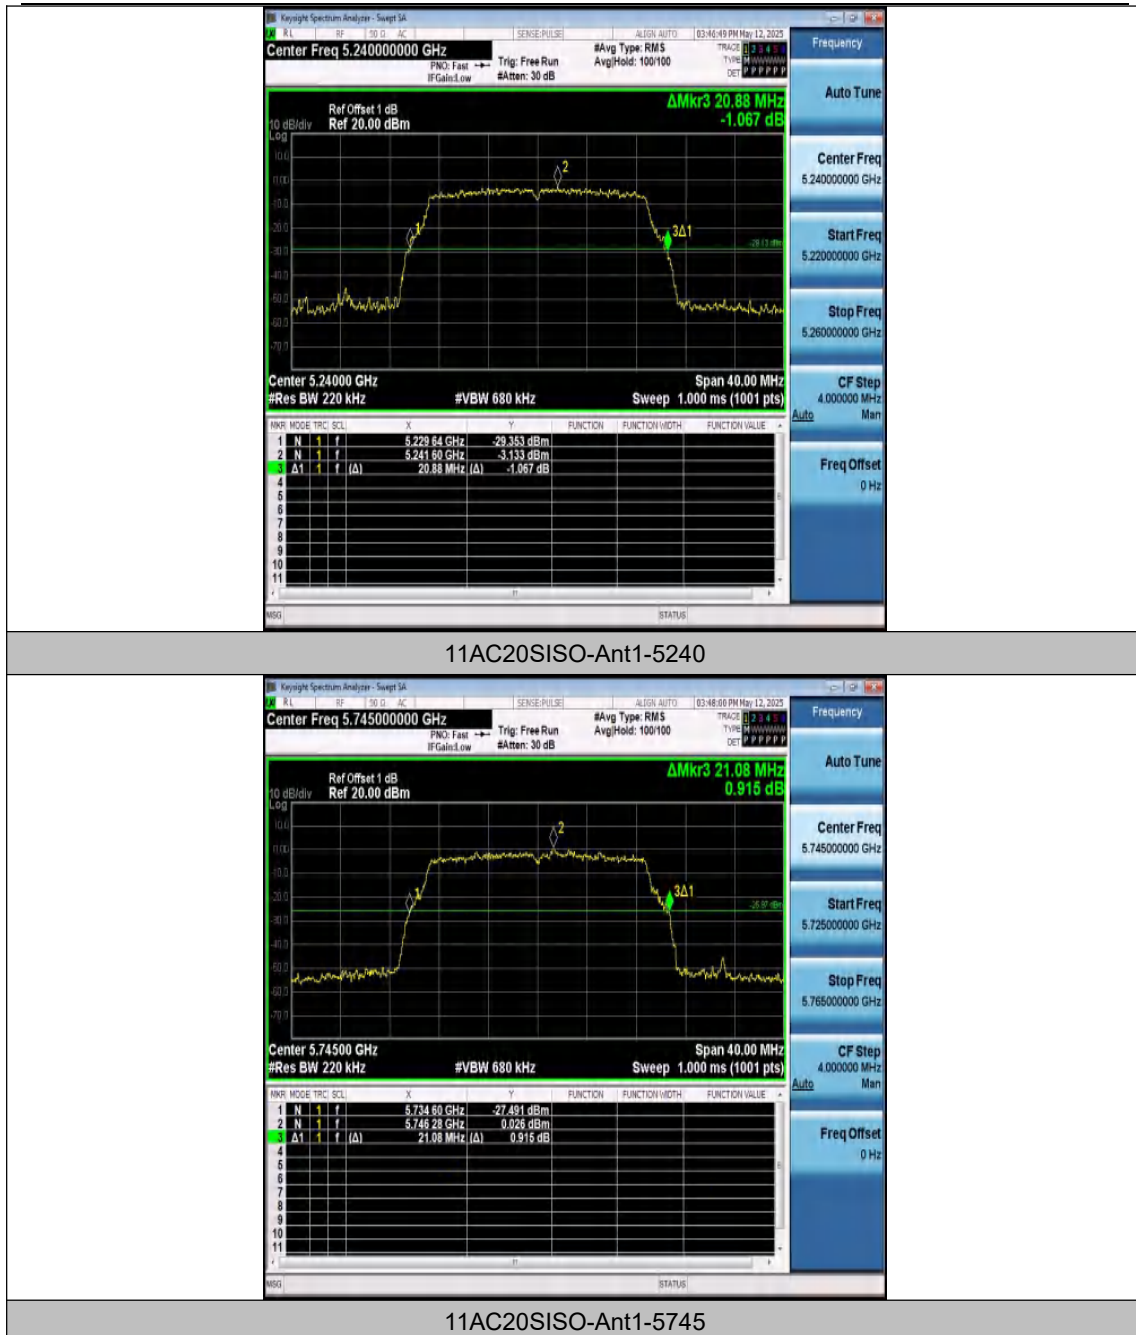


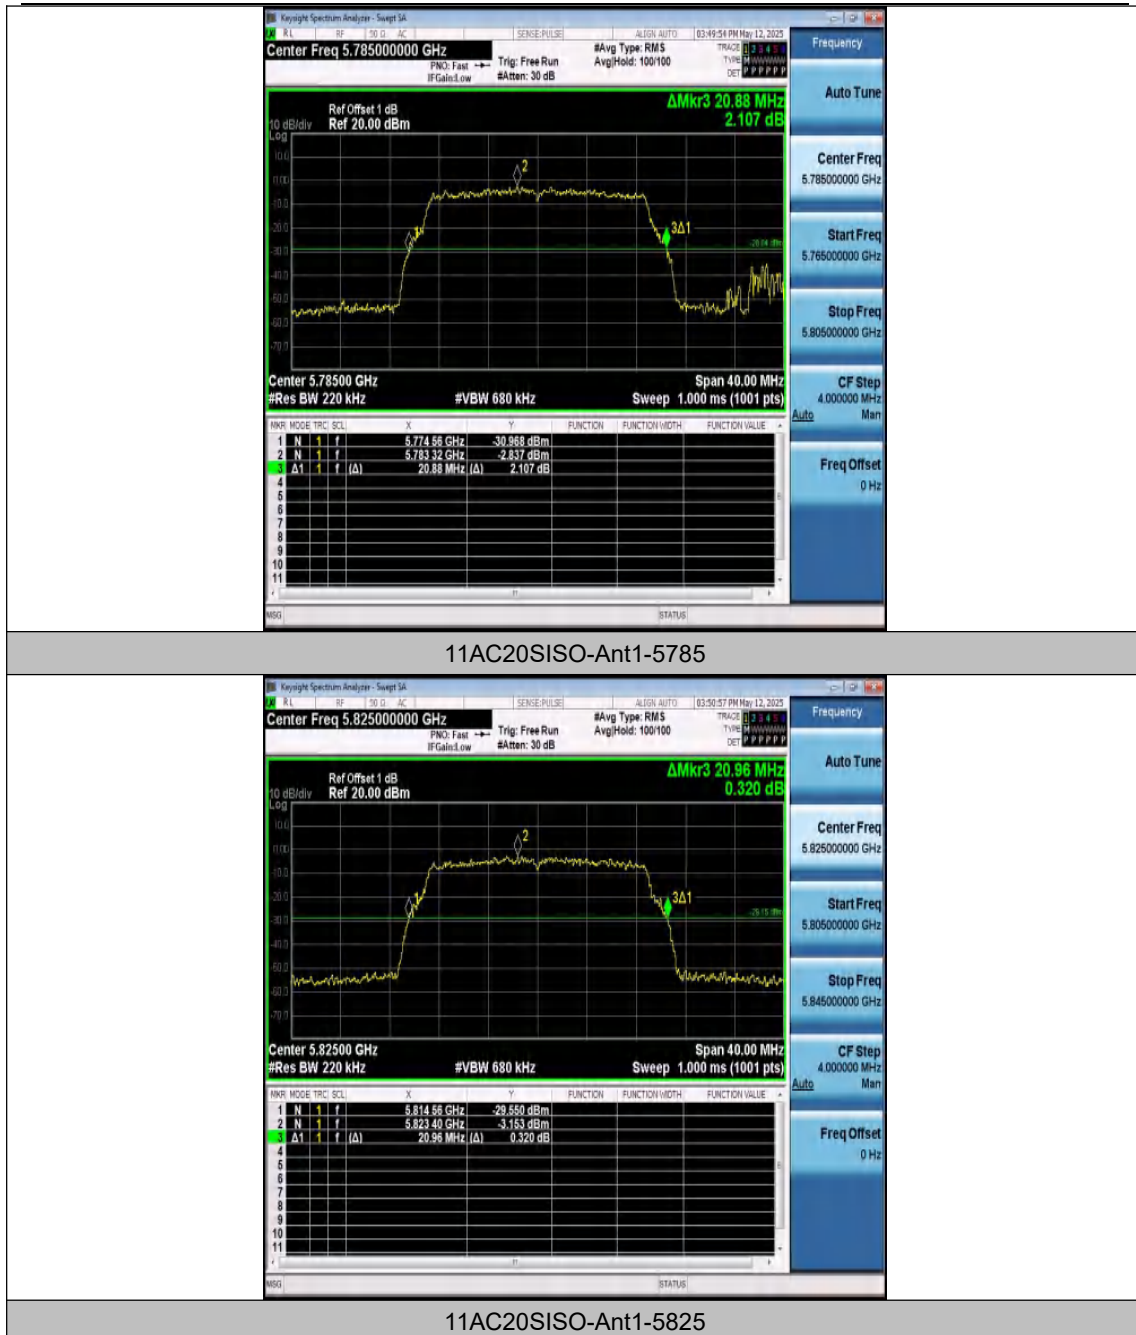

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

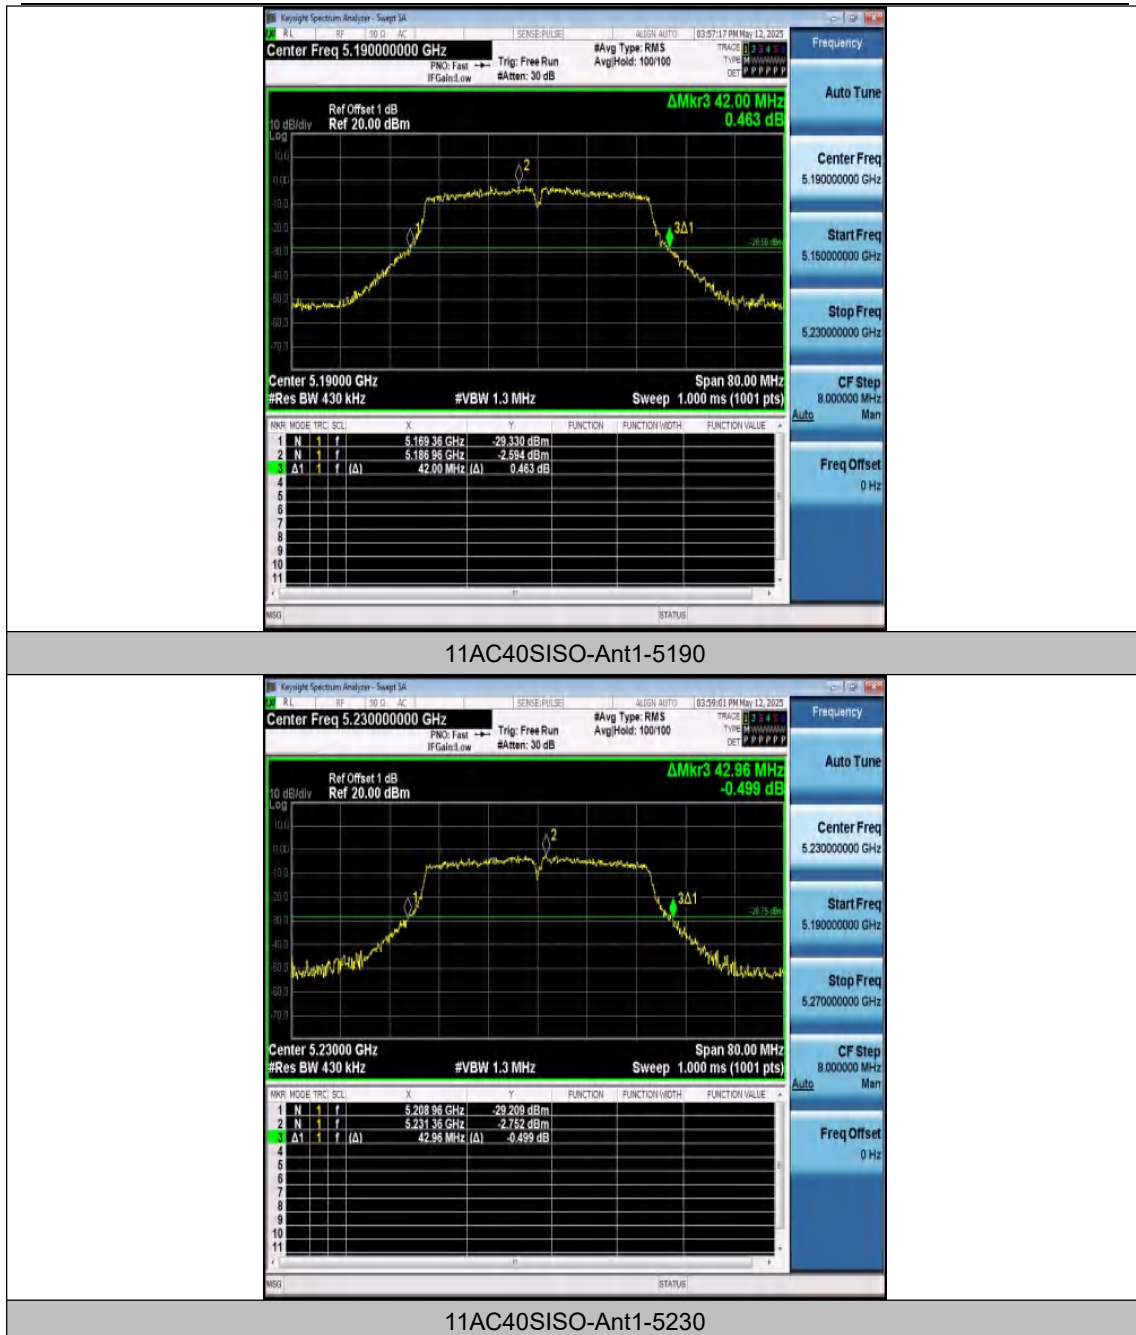




Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

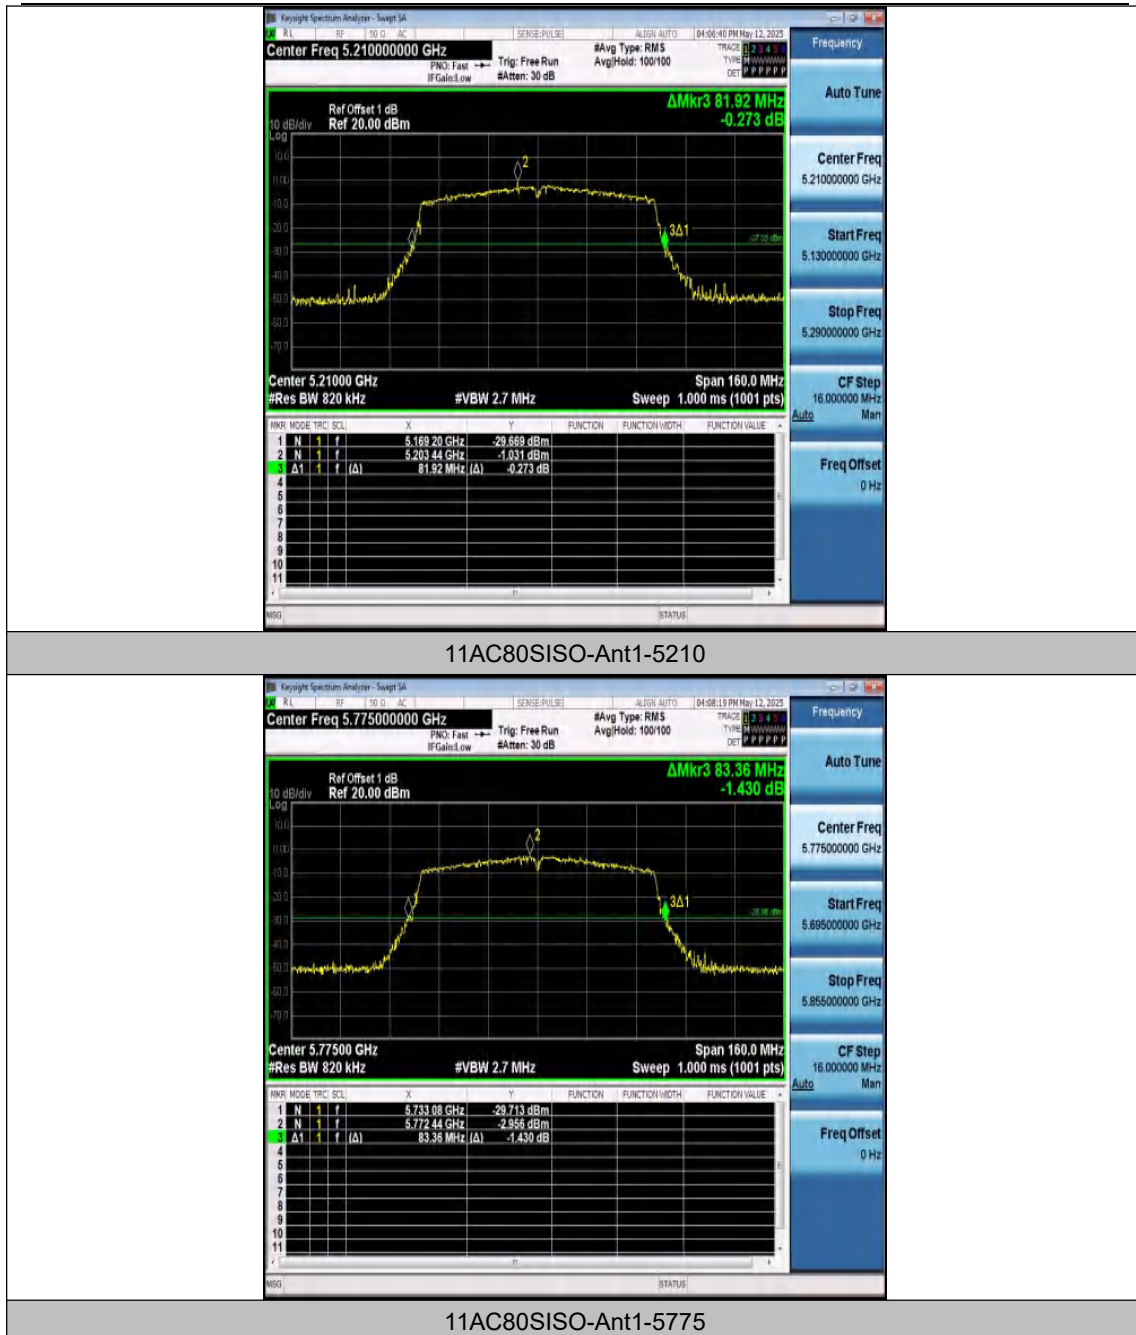


Appendix A2: 99% Occupied Bandwidth

Test Result

Test Mode	Antenna	Frequency[MHz]	OCB [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5180	17.020	5171.5378	5188.5578	---	---
11A	Ant1	5220	16.944	5211.5687	5228.5127	---	---
11A	Ant1	5240	16.966	5231.5307	5248.4967	---	---
11A	Ant1	5745	16.900	5736.5524	5753.4524	---	---
11A	Ant1	5785	16.878	5776.5663	5793.4443	---	---
11A	Ant1	5825	16.870	5816.5878	5833.4578	---	---
11N20SISO	Ant1	5180	17.993	5171.0198	5189.0128	---	---
11N20SISO	Ant1	5220	17.963	5211.0345	5228.9975	---	---
11N20SISO	Ant1	5240	17.947	5231.0736	5249.0206	---	---
11N20SISO	Ant1	5745	17.972	5736.0608	5754.0328	---	---
11N20SISO	Ant1	5785	18.006	5776.0141	5794.0201	---	---
11N20SISO	Ant1	5825	17.959	5816.0679	5834.0269	---	---
11N40SISO	Ant1	5190	36.444	5171.9015	5208.3455	---	---
11N40SISO	Ant1	5230	36.436	5211.8796	5248.3156	---	---
11N40SISO	Ant1	5755	36.354	5736.8355	5773.1895	---	---
11N40SISO	Ant1	5795	36.505	5776.7681	5813.2731	---	---
11AC20SISO	Ant1	5180	18.039	5171.0170	5189.0560	---	---
11AC20SISO	Ant1	5220	17.955	5211.0316	5228.9866	---	---
11AC20SISO	Ant1	5240	17.961	5231.0326	5248.9936	---	---
11AC20SISO	Ant1	5745	18.012	5735.9805	5753.9925	---	---
11AC20SISO	Ant1	5785	18.066	5775.9878	5794.0538	---	---
11AC20SISO	Ant1	5825	17.982	5816.0350	5834.0170	---	---
11AC40SISO	Ant1	5190	36.440	5171.8913	5208.3313	---	---
11AC40SISO	Ant1	5230	36.477	5211.8724	5248.3494	---	---
11AC40SISO	Ant1	5755	36.398	5736.8310	5773.2290	---	---
11AC40SISO	Ant1	5795	36.384	5776.8665	5813.2505	---	---
11AC80SISO	Ant1	5210	75.070	5172.7599	5247.8299	---	---
11AC80SISO	Ant1	5775	74.957	5737.5690	5812.5260	---	---


Test Graphs

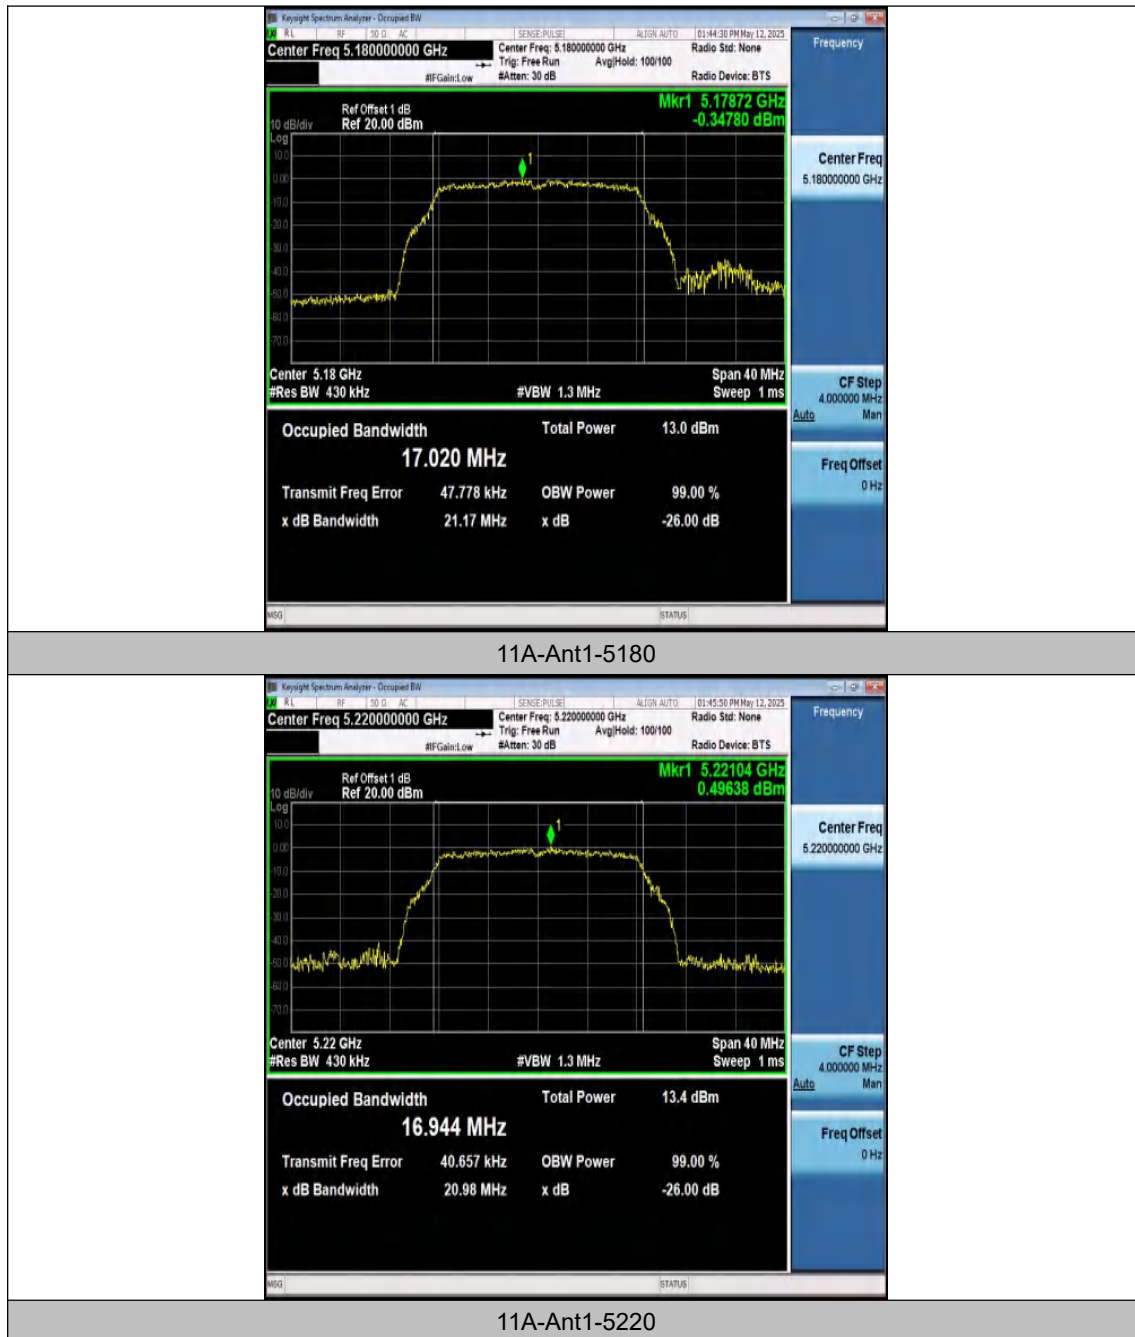



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

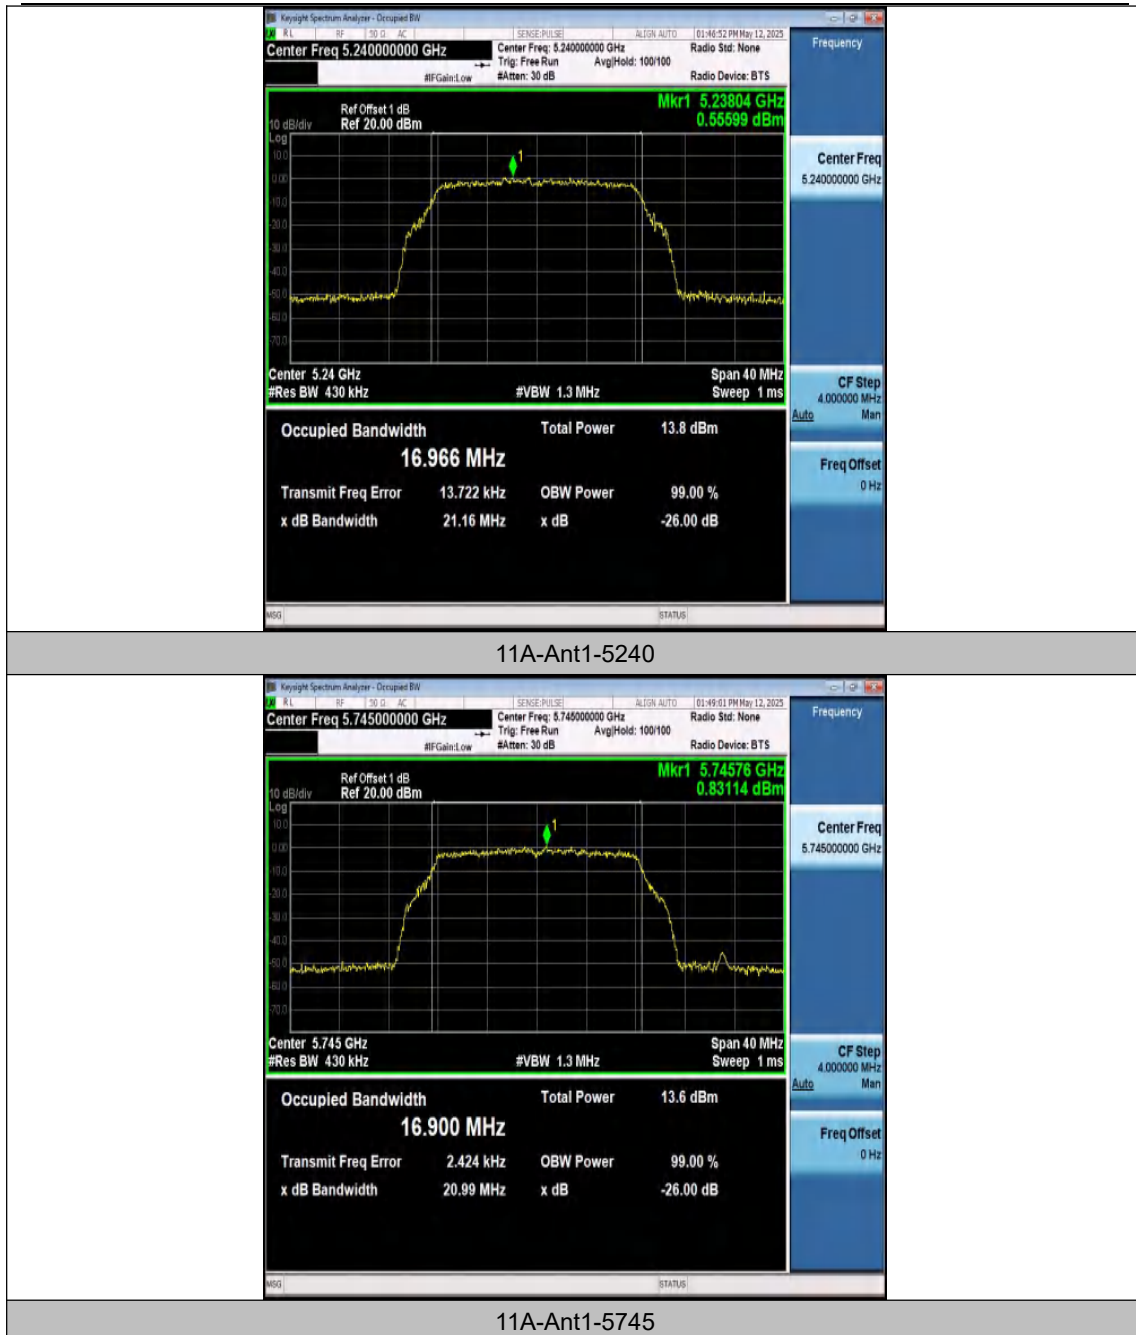

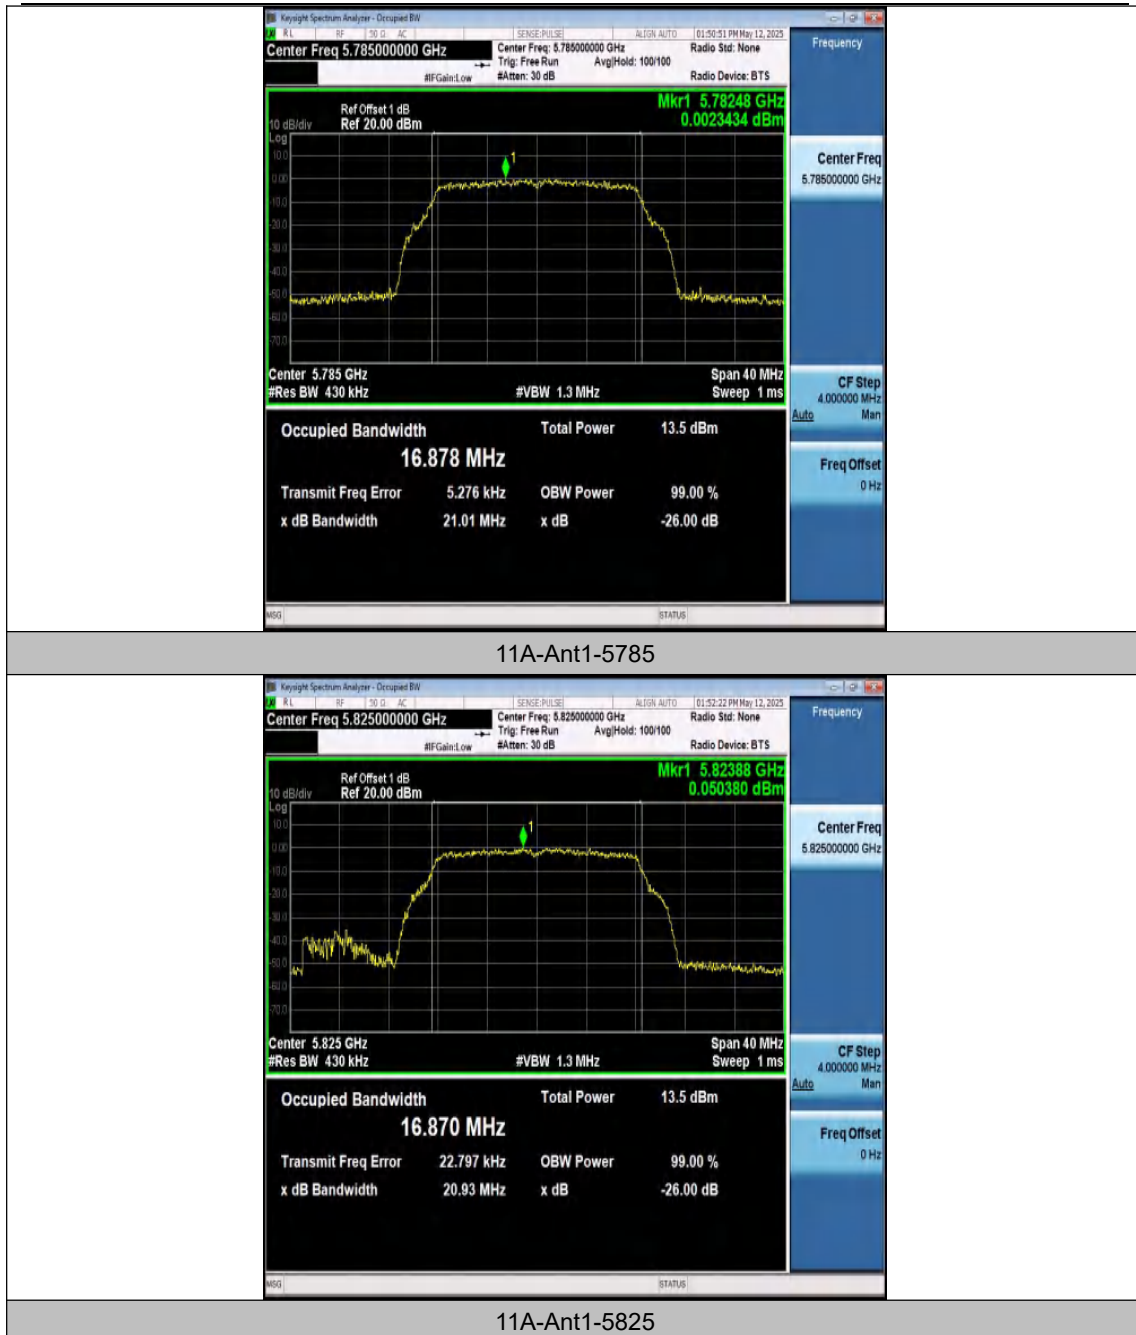

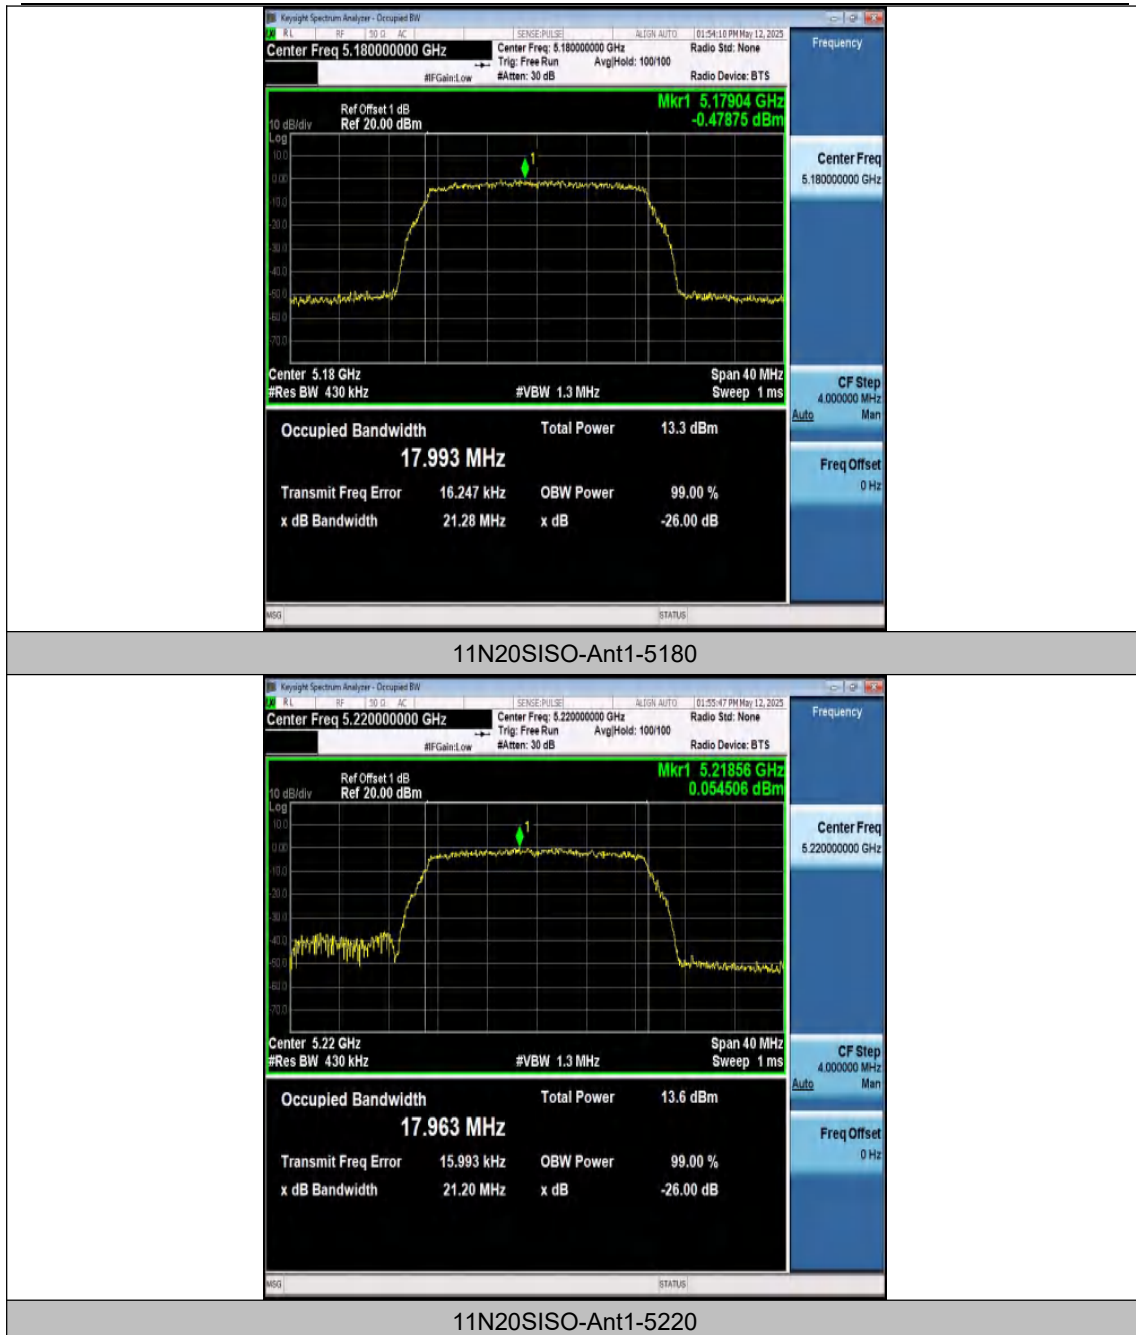



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com



Hotline
400-003-0500
www.anbotech.com

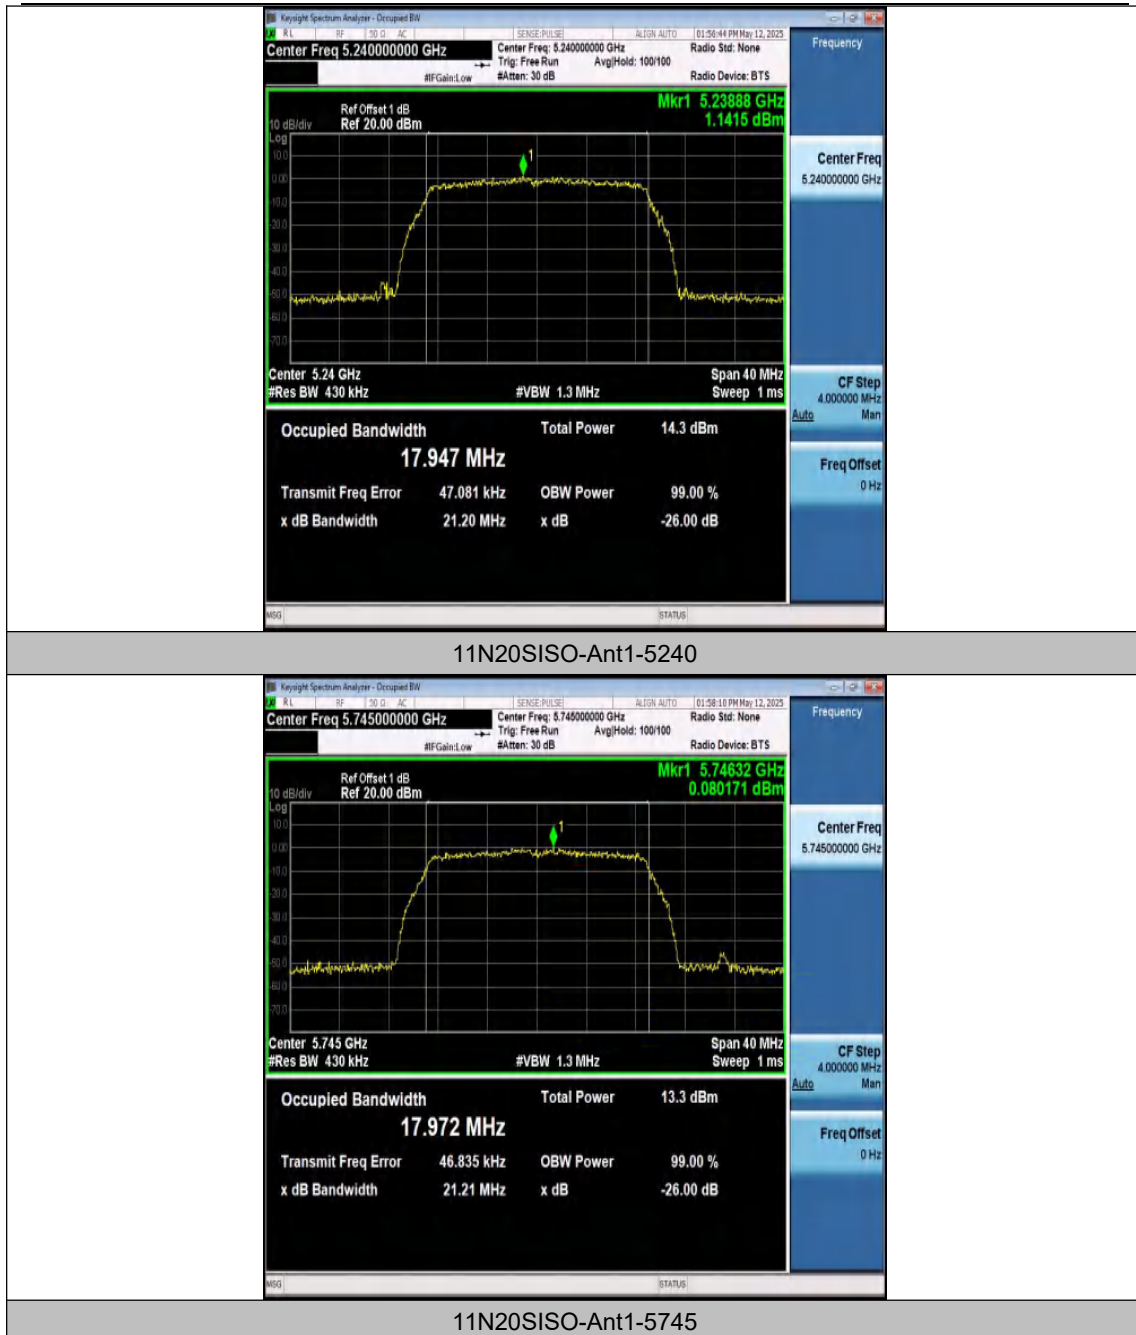

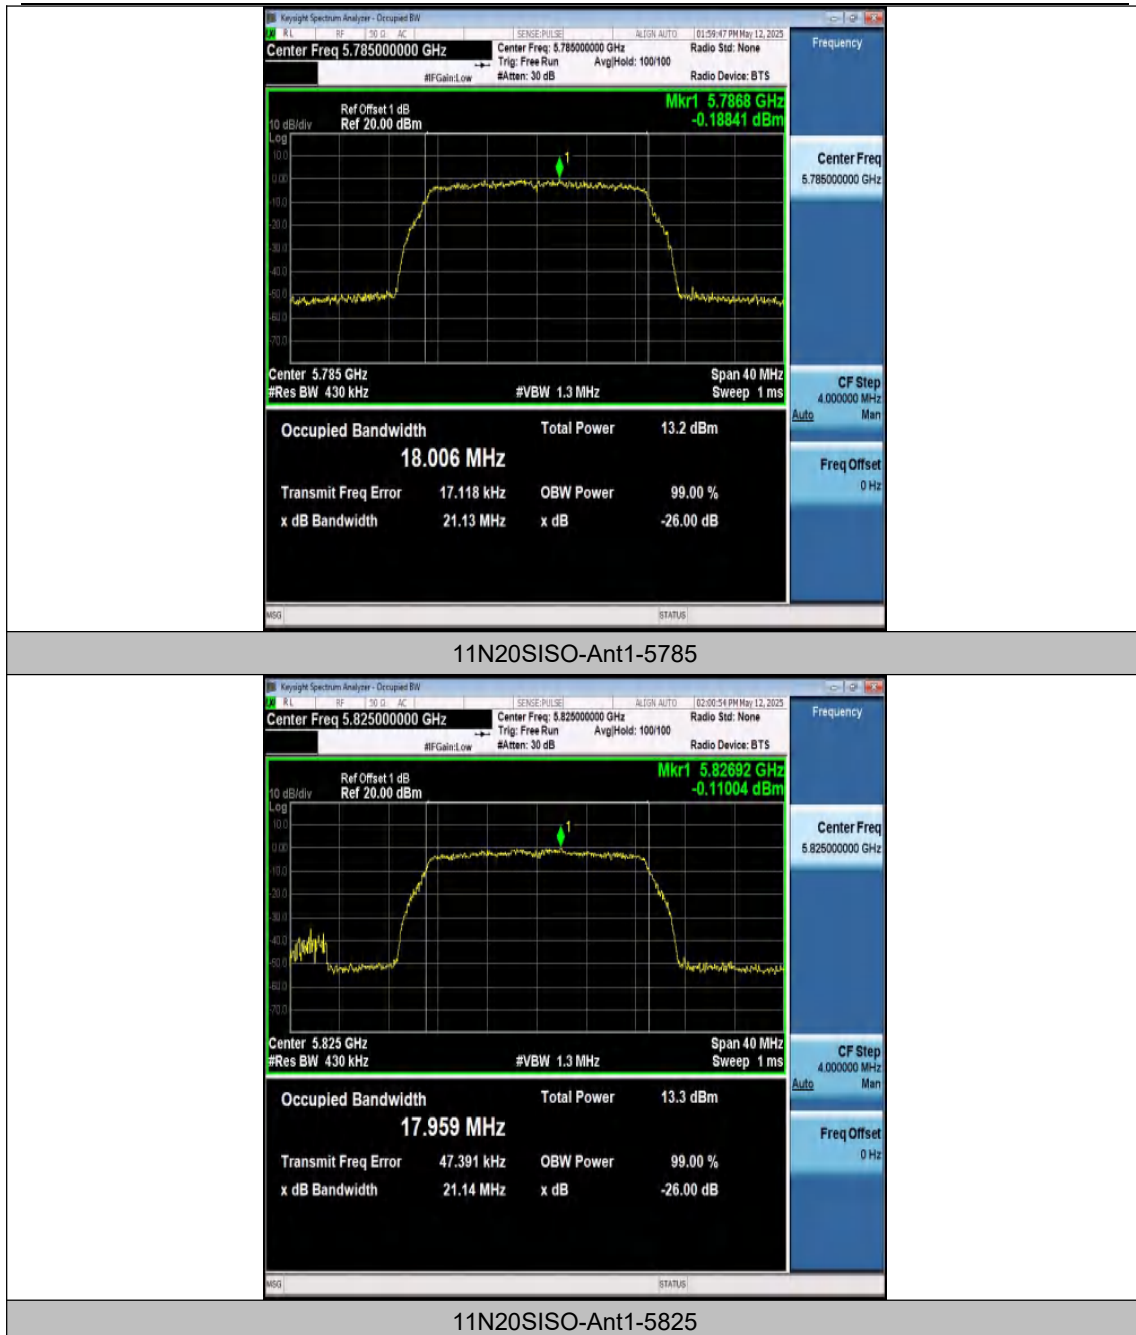

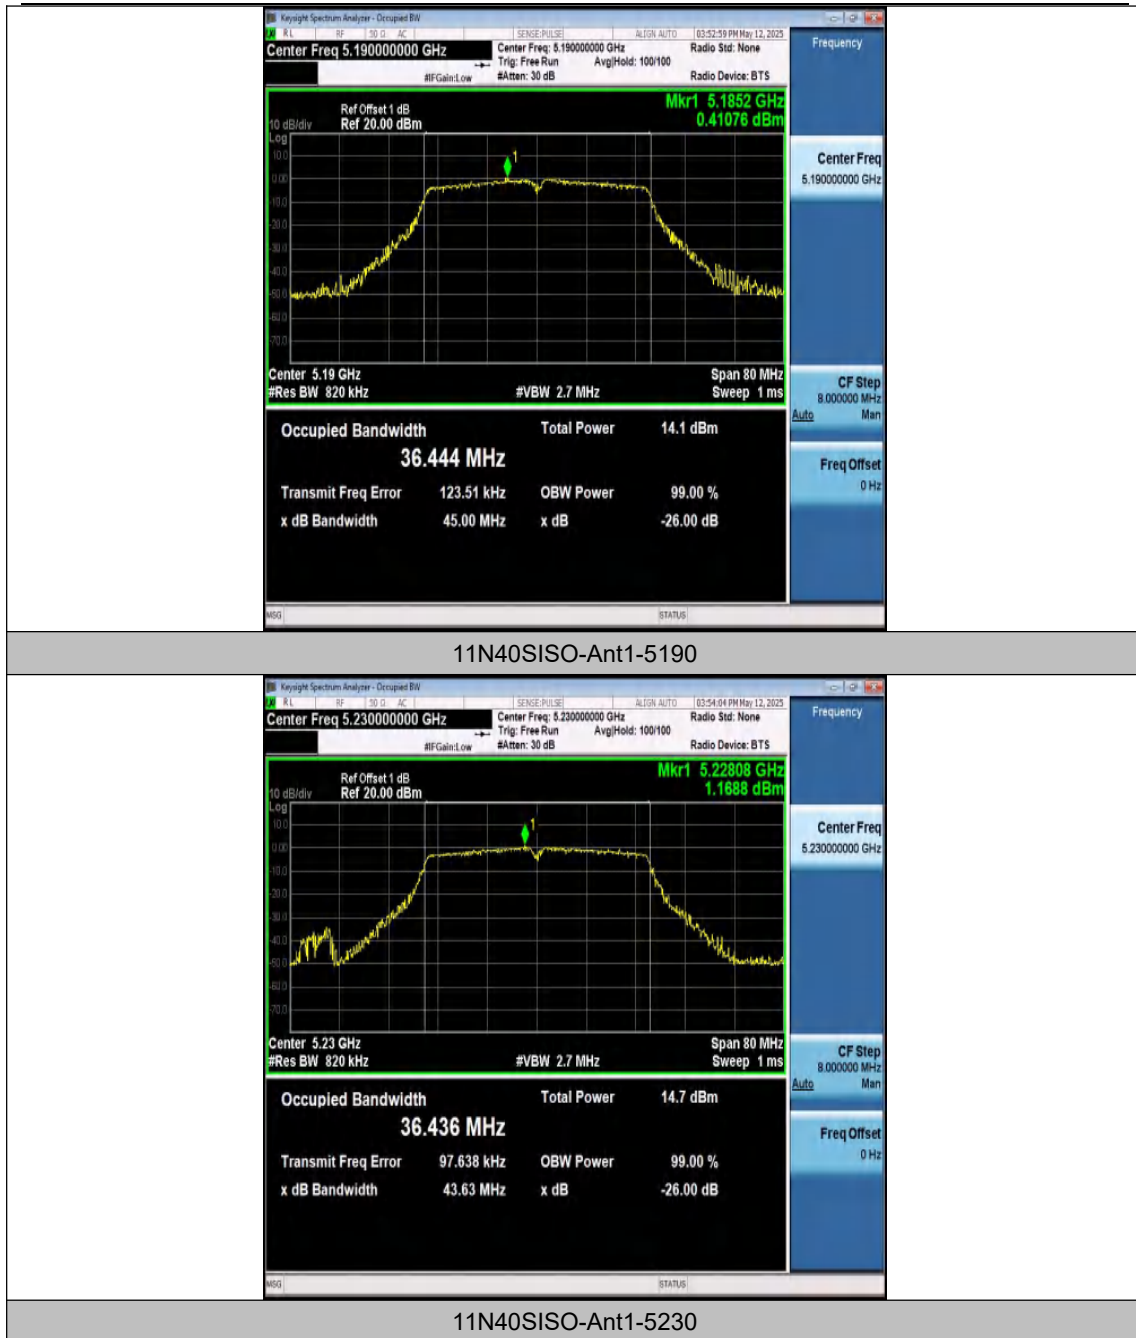




Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

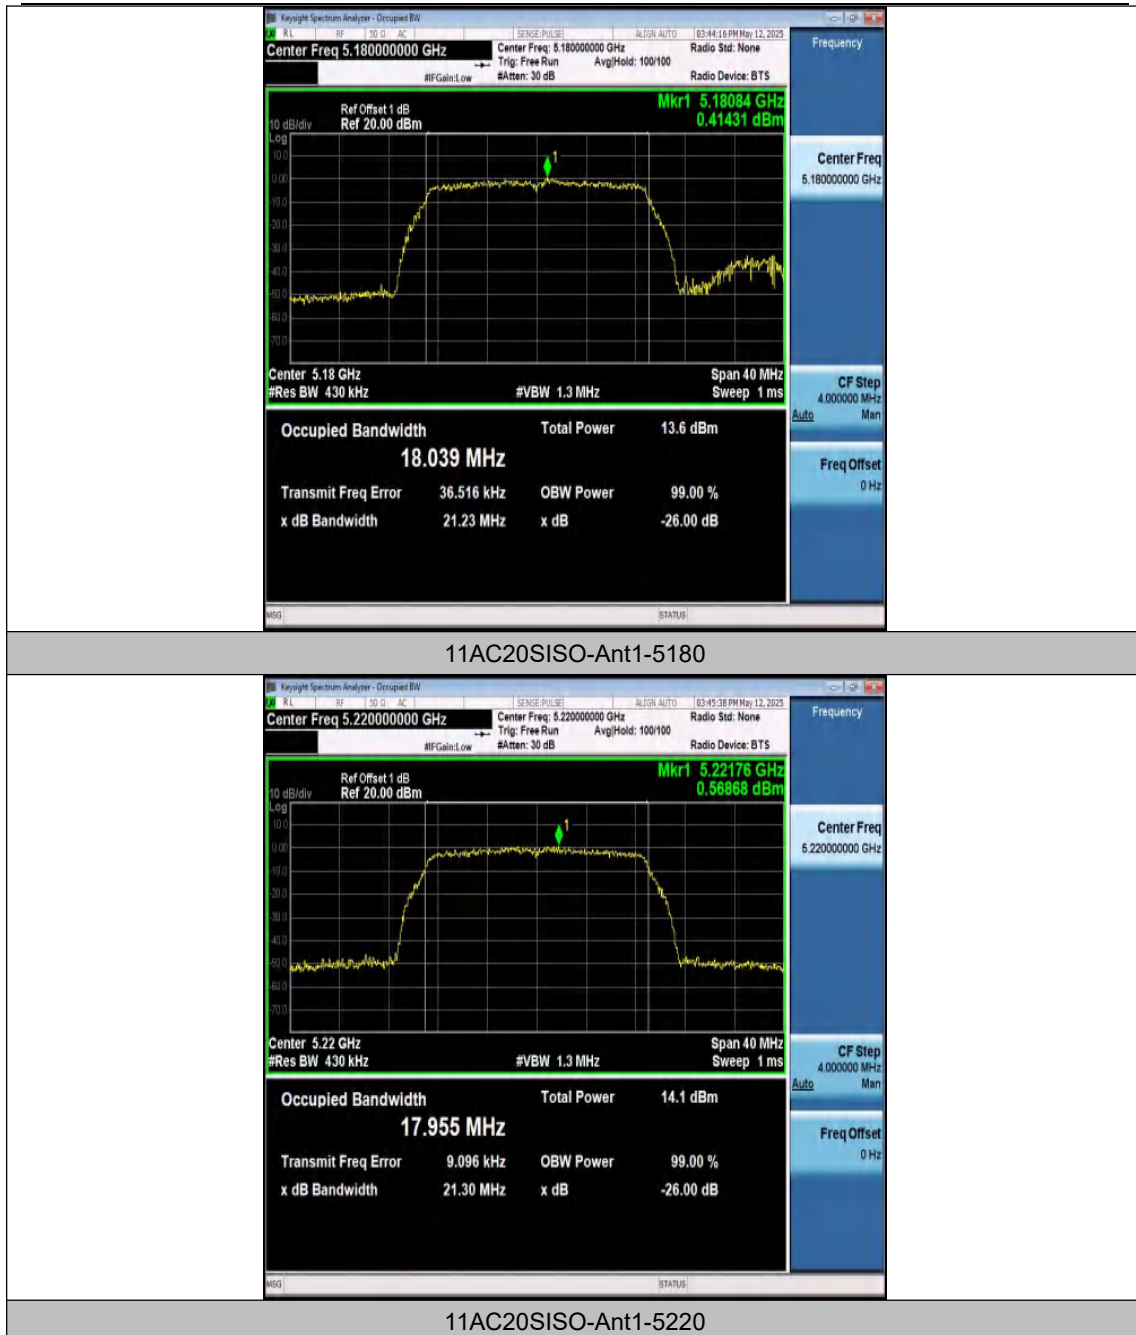



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

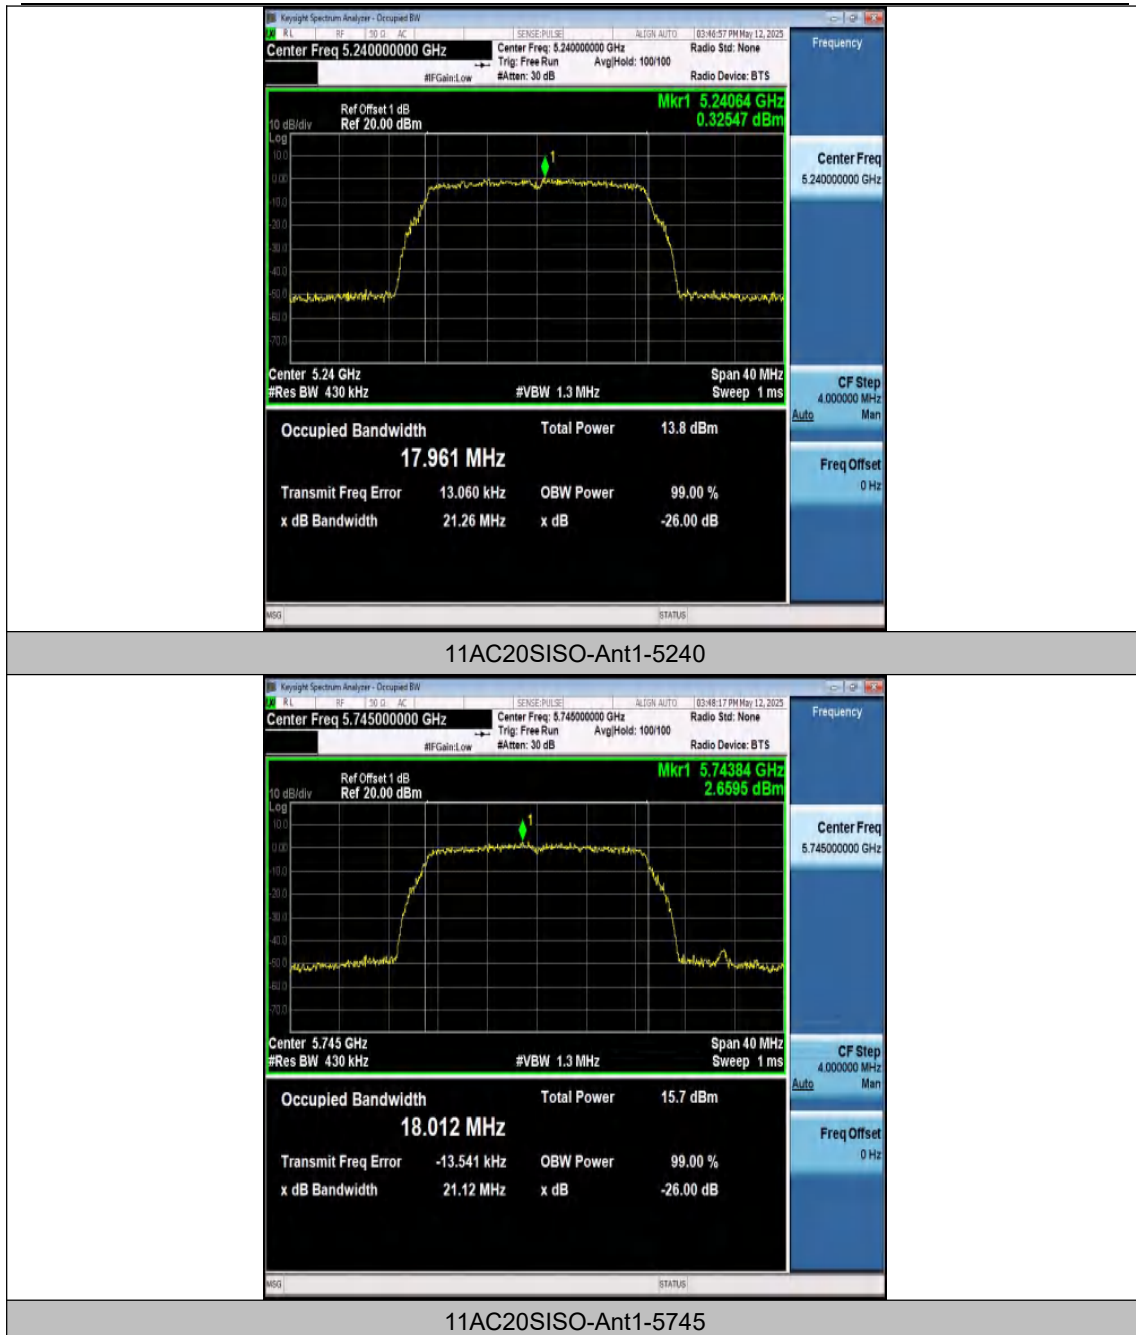

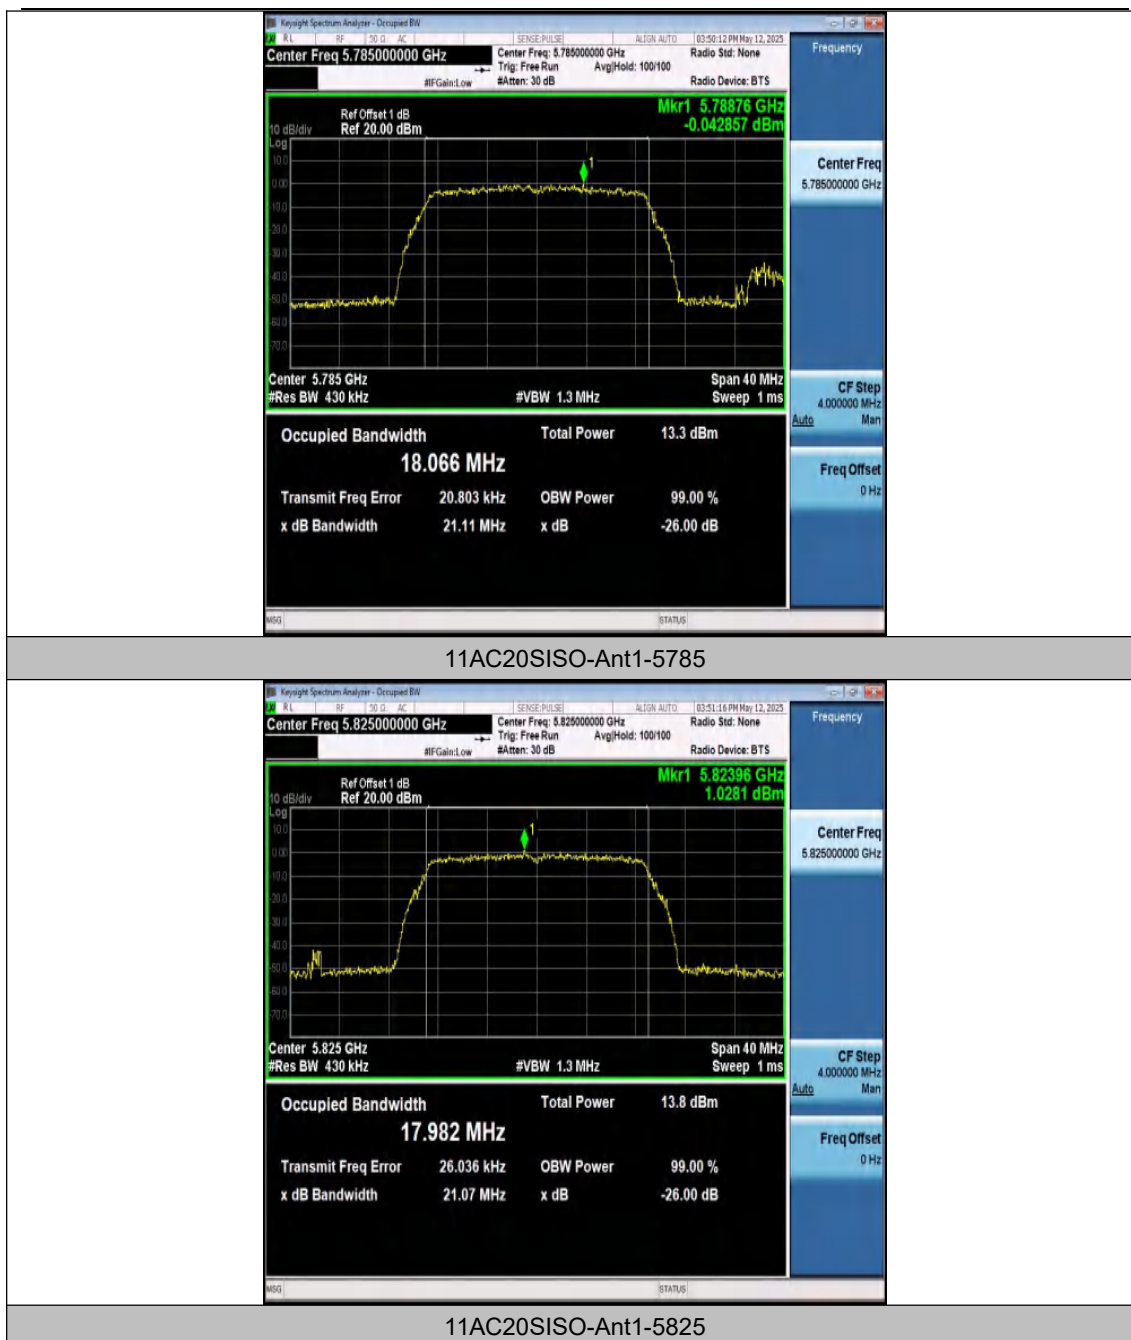

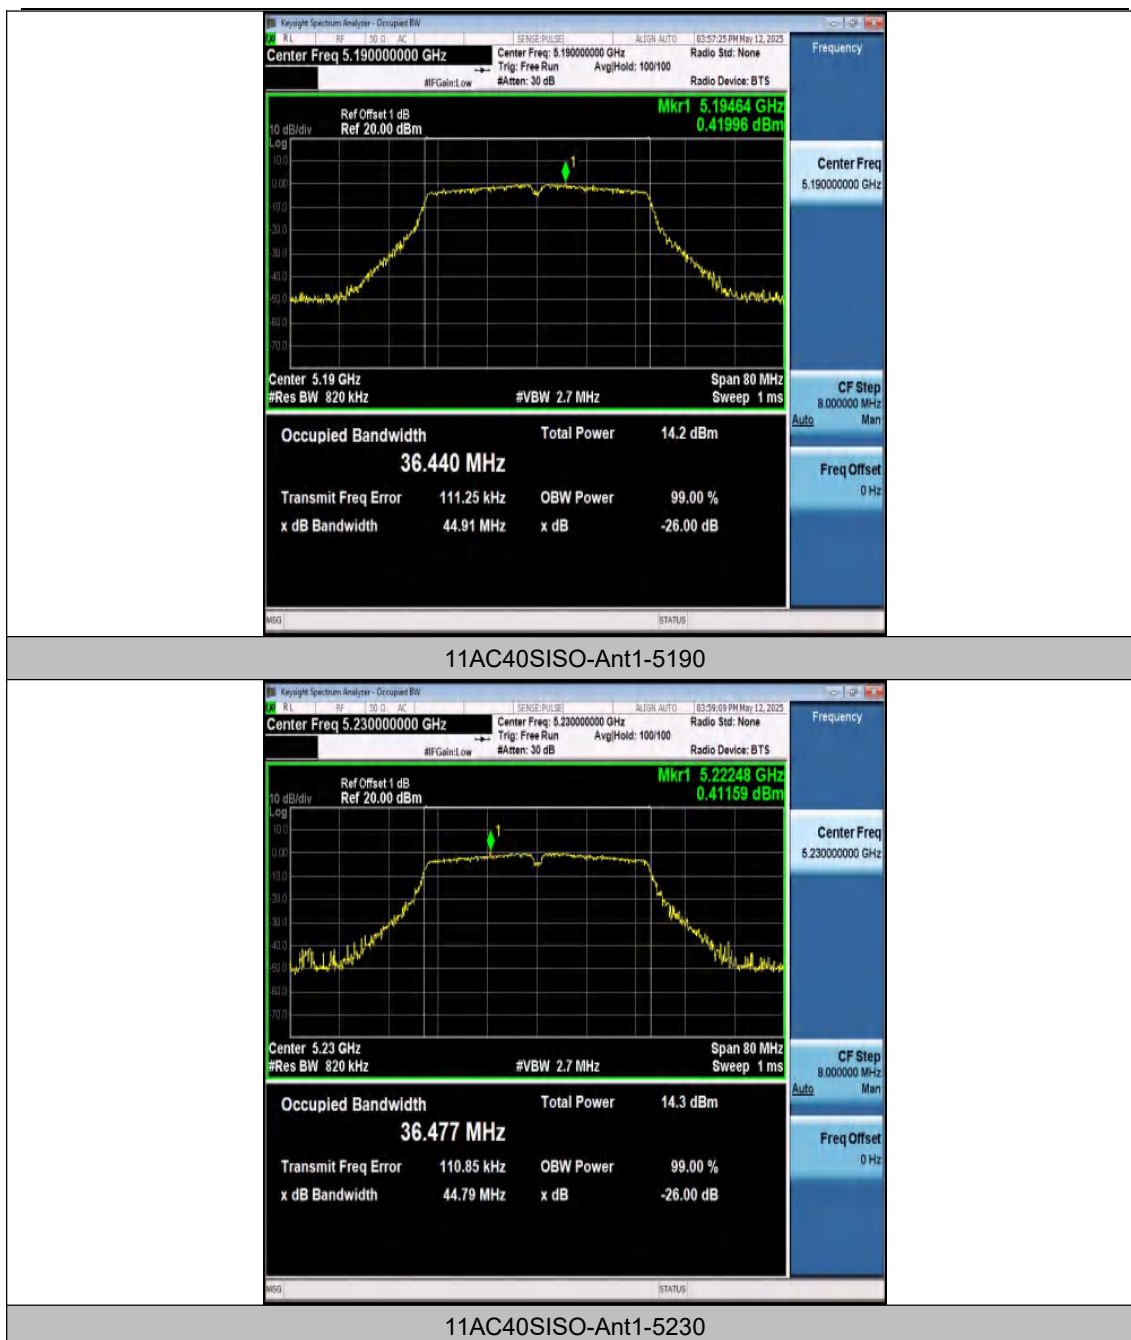

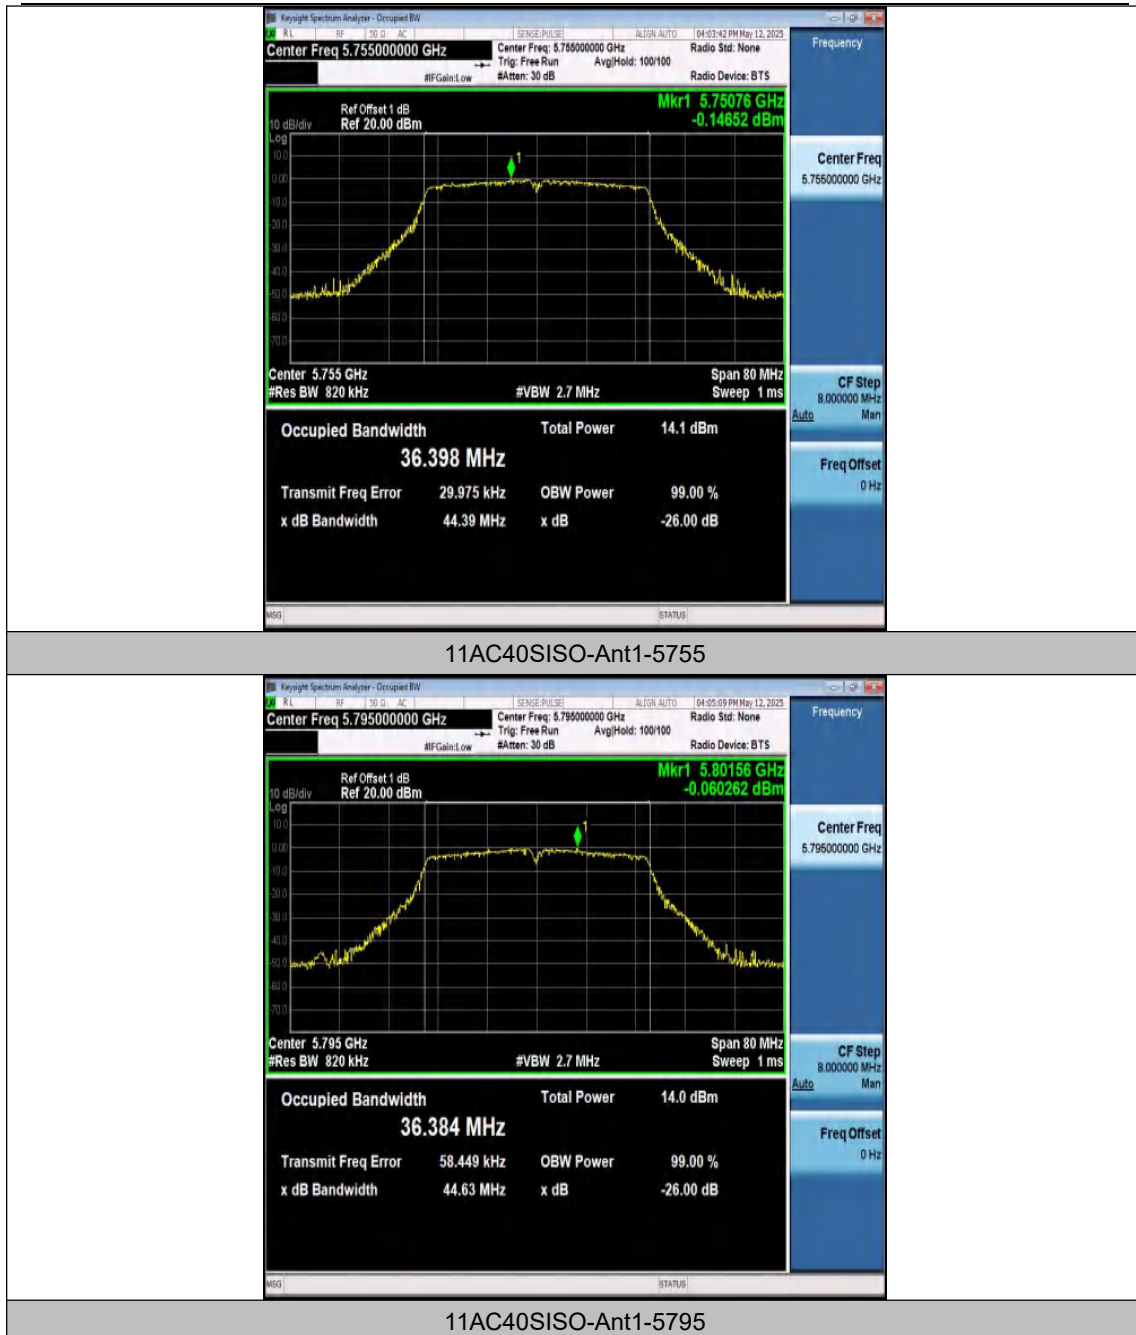

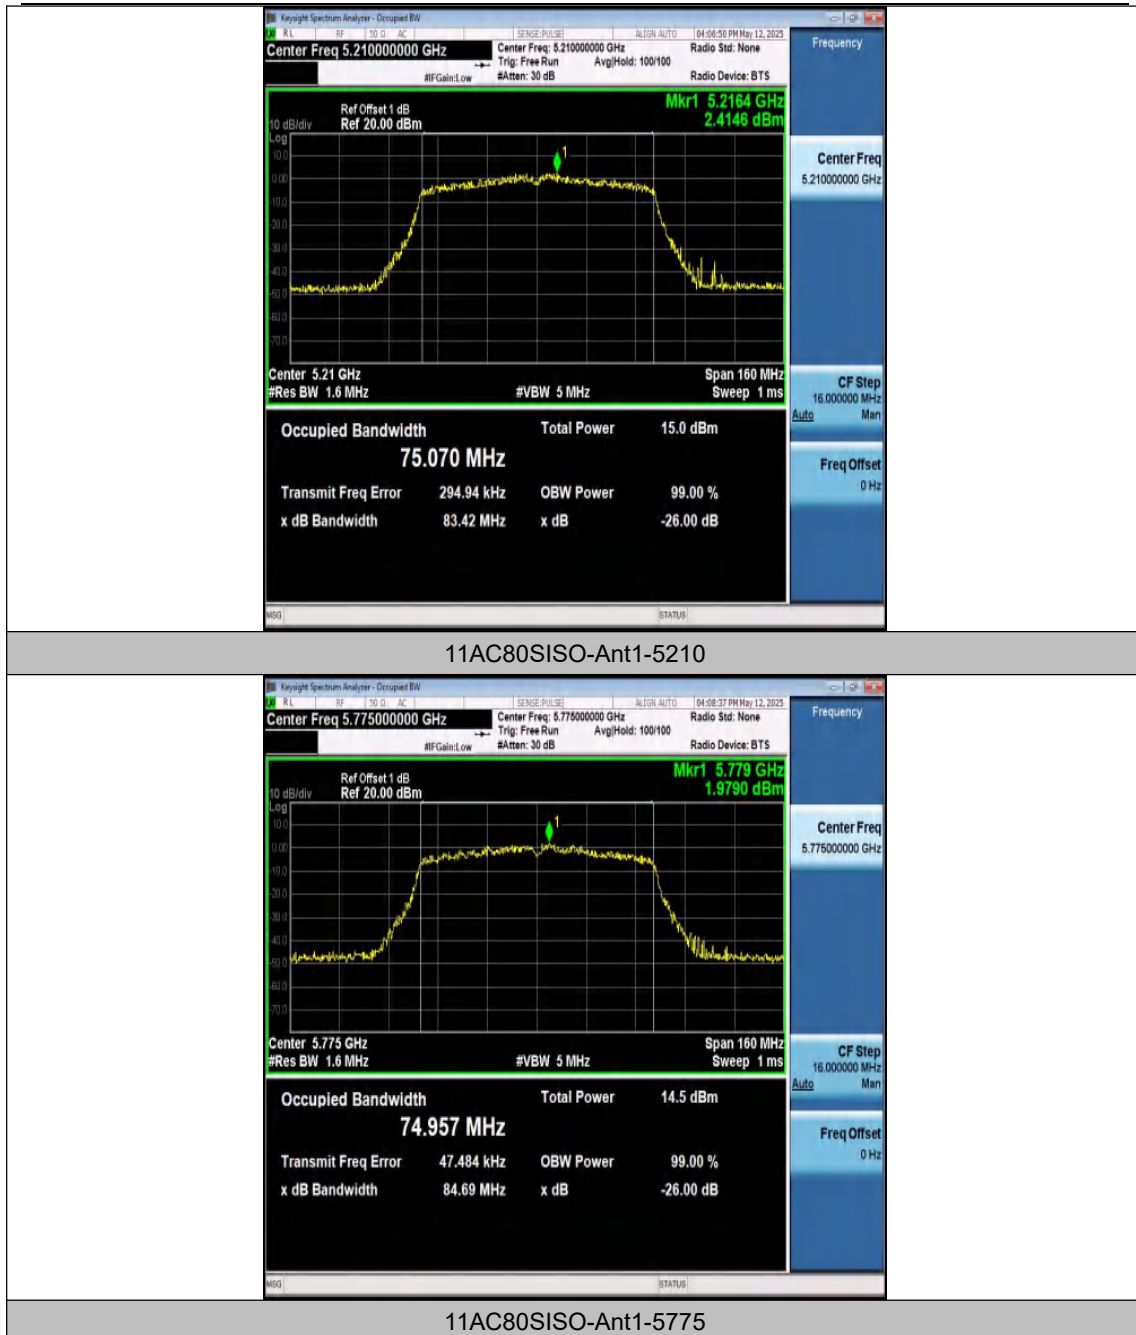


Appendix A3: Minimum 6dB Bandwidth


Test Result B4


Test Mode	Antenna	Frequency[MHz]	6db EBW [MHz]	FL[MHz]	FH[MHz]	Limit[MHz]	Verdict
11A	Ant1	5745	14.440	5737.440	5751.880	0.5	PASS
11A	Ant1	5785	16.320	5776.840	5793.160	0.5	PASS
11A	Ant1	5825	16.320	5816.840	5833.160	0.5	PASS
11N20SISO	Ant1	5745	16.880	5736.480	5753.360	0.5	PASS
11N20SISO	Ant1	5785	17.360	5776.400	5793.760	0.5	PASS
11N20SISO	Ant1	5825	17.600	5816.200	5833.800	0.5	PASS
11N40SISO	Ant1	5755	35.120	5737.400	5772.520	0.5	PASS
11N40SISO	Ant1	5795	34.960	5777.560	5812.520	0.5	PASS
11AC20SISO	Ant1	5745	16.240	5737.080	5753.320	0.5	PASS
11AC20SISO	Ant1	5785	16.880	5776.520	5793.400	0.5	PASS
11AC20SISO	Ant1	5825	17.560	5816.200	5833.760	0.5	PASS
11AC40SISO	Ant1	5755	35.040	5737.400	5772.440	0.5	PASS
11AC40SISO	Ant1	5795	31.680	5779.640	5811.320	0.5	PASS
11AC80SISO	Ant1	5775	70.080	5738.680	5808.760	0.5	PASS



Test Graphs B4

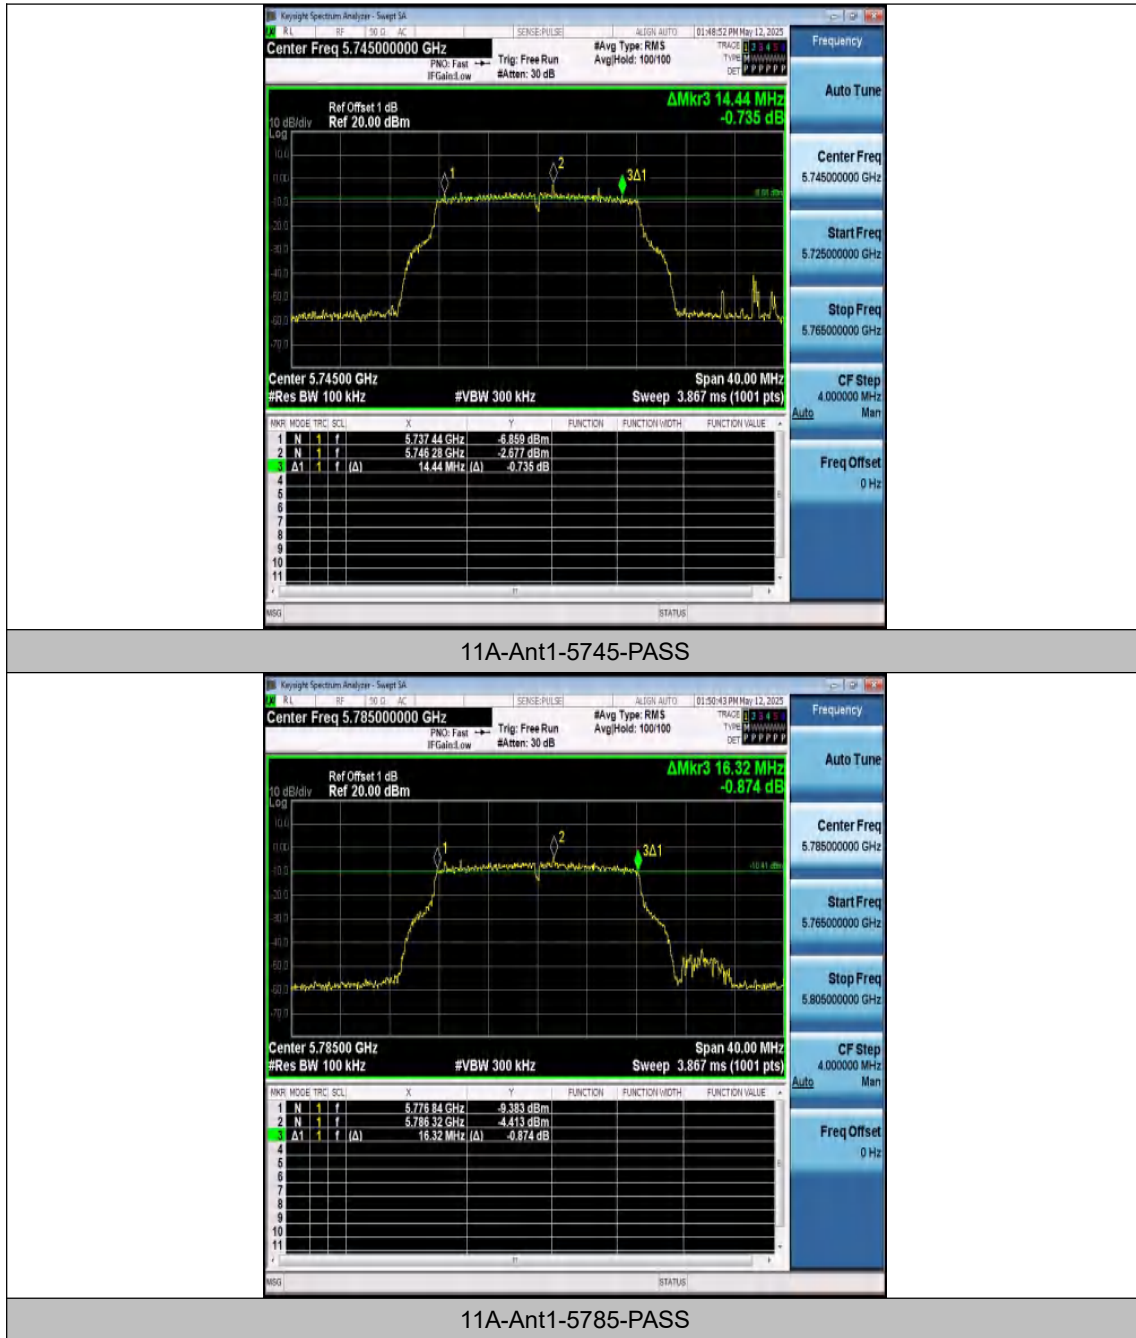

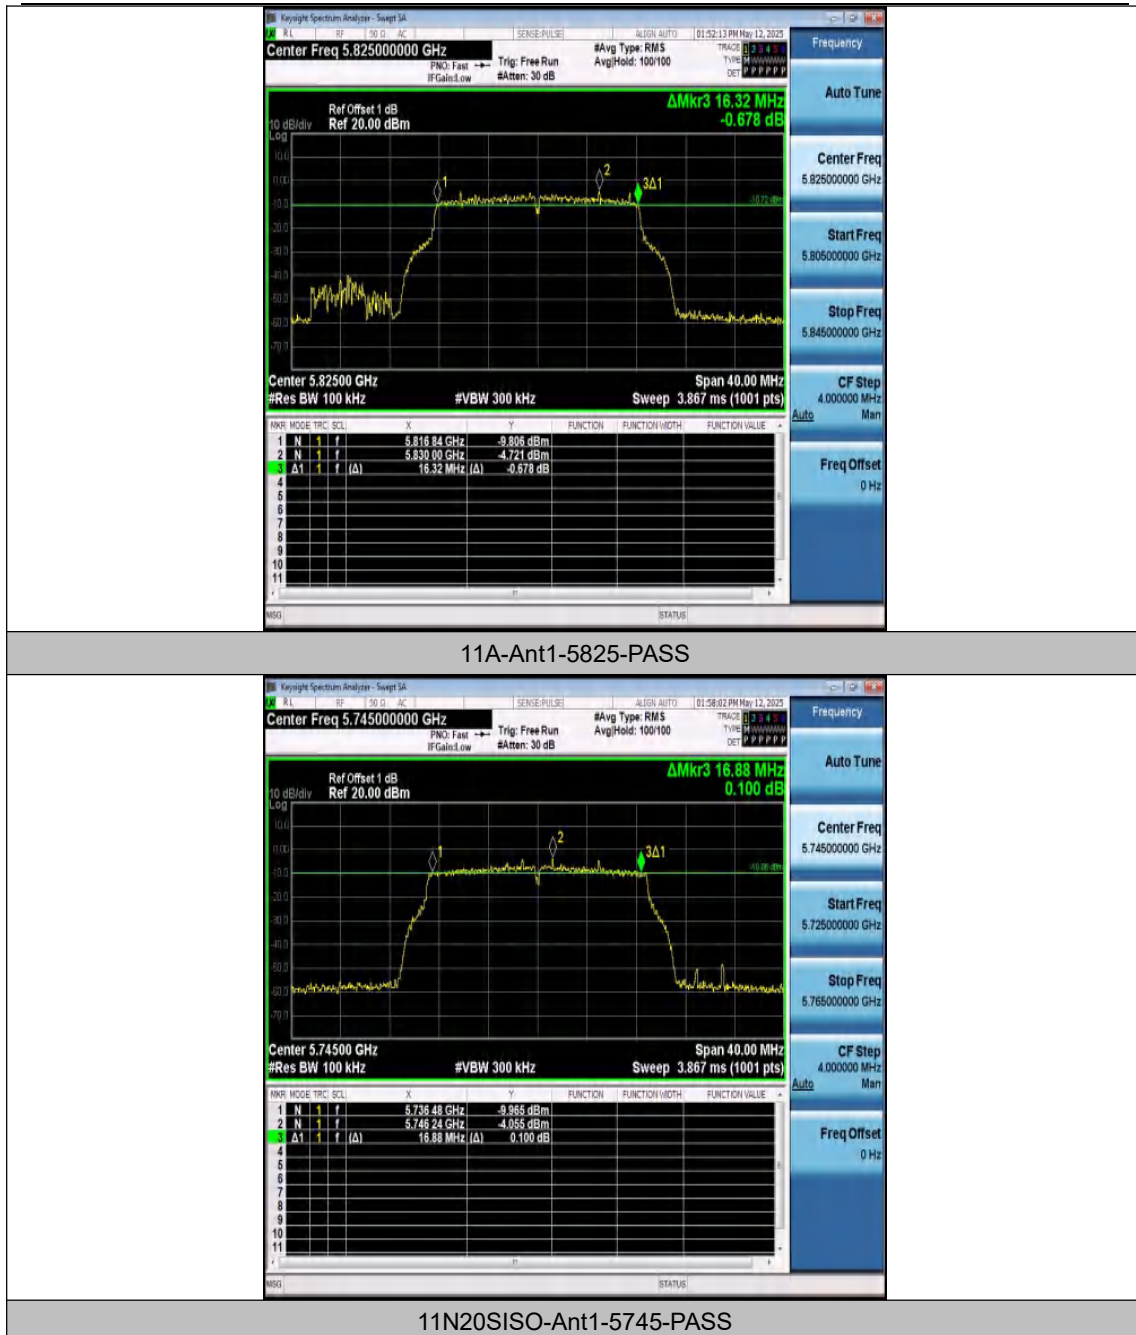


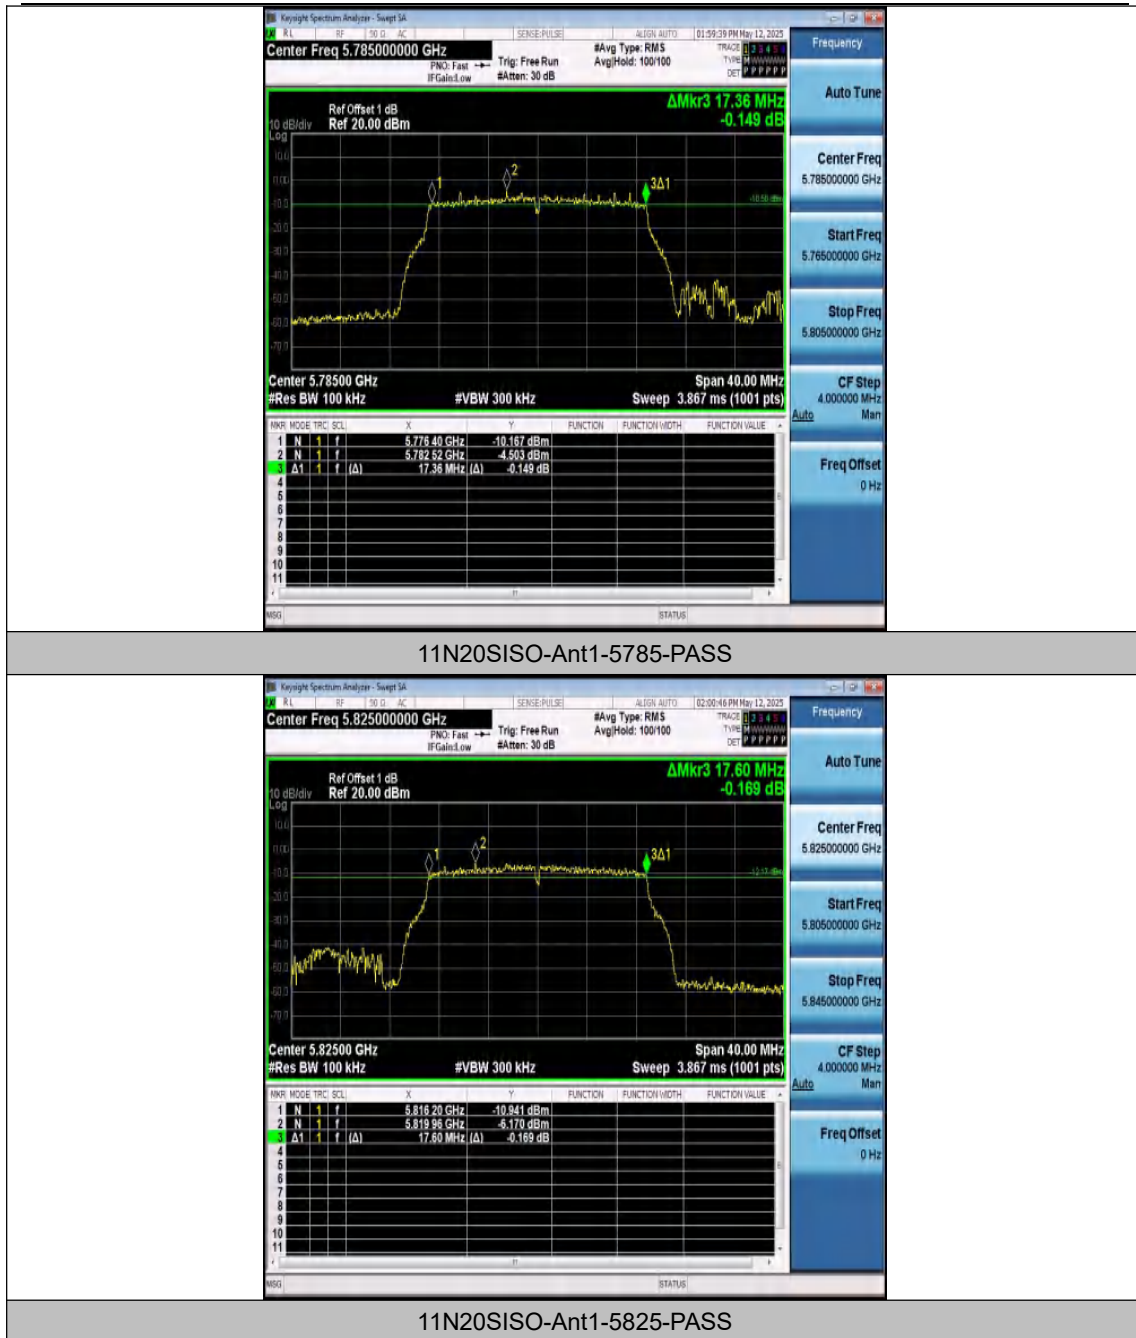



Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

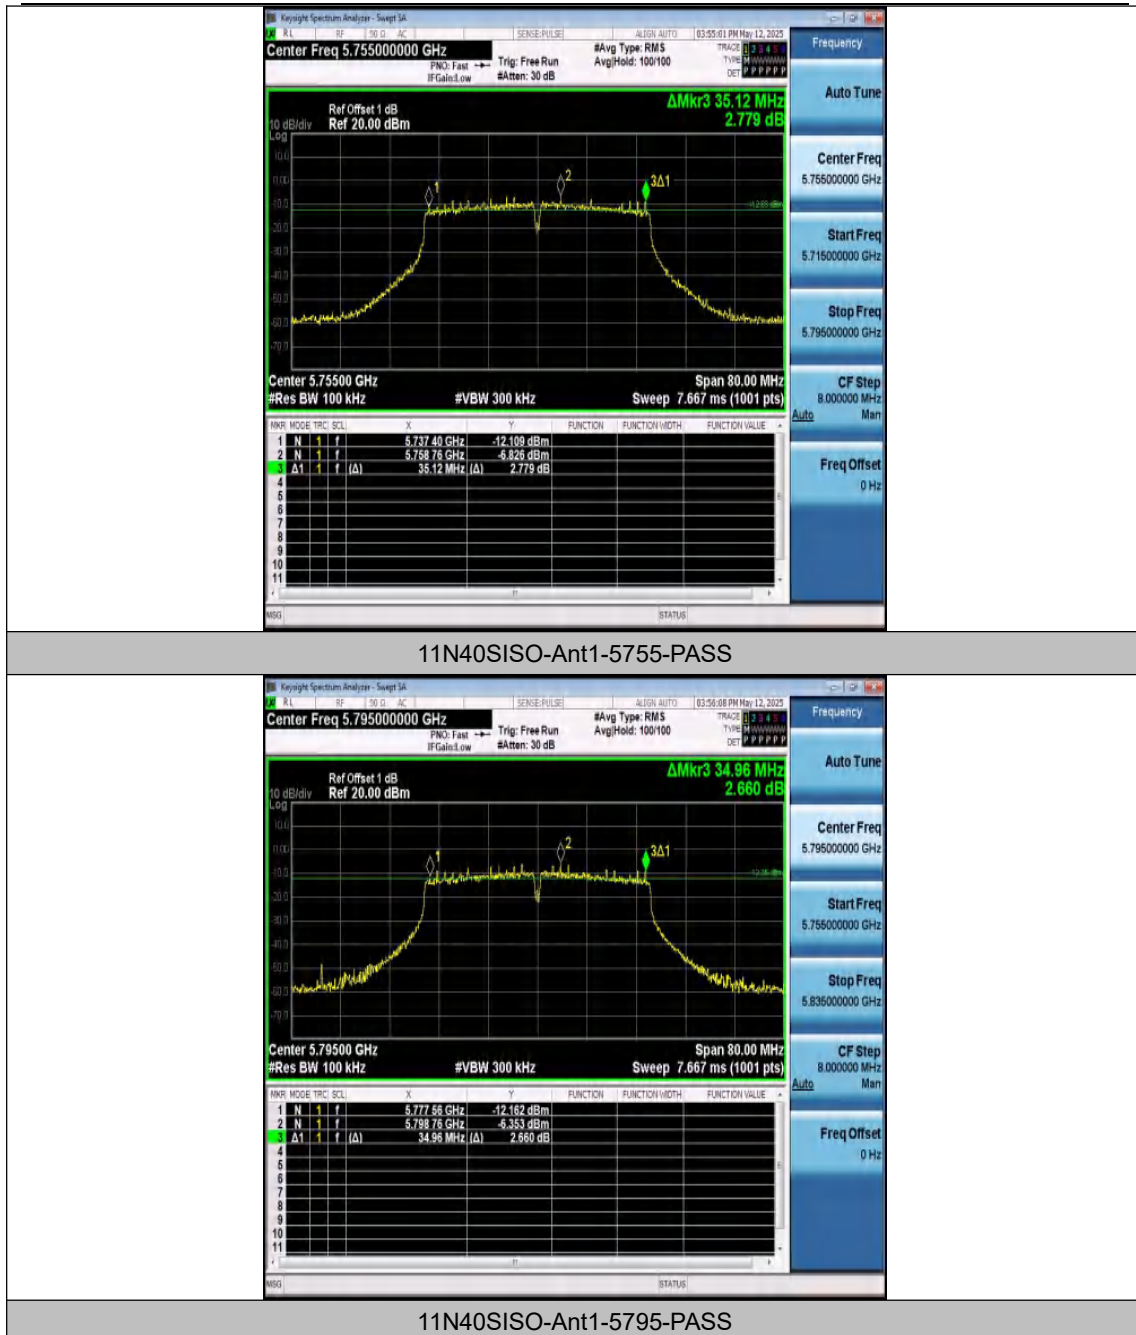

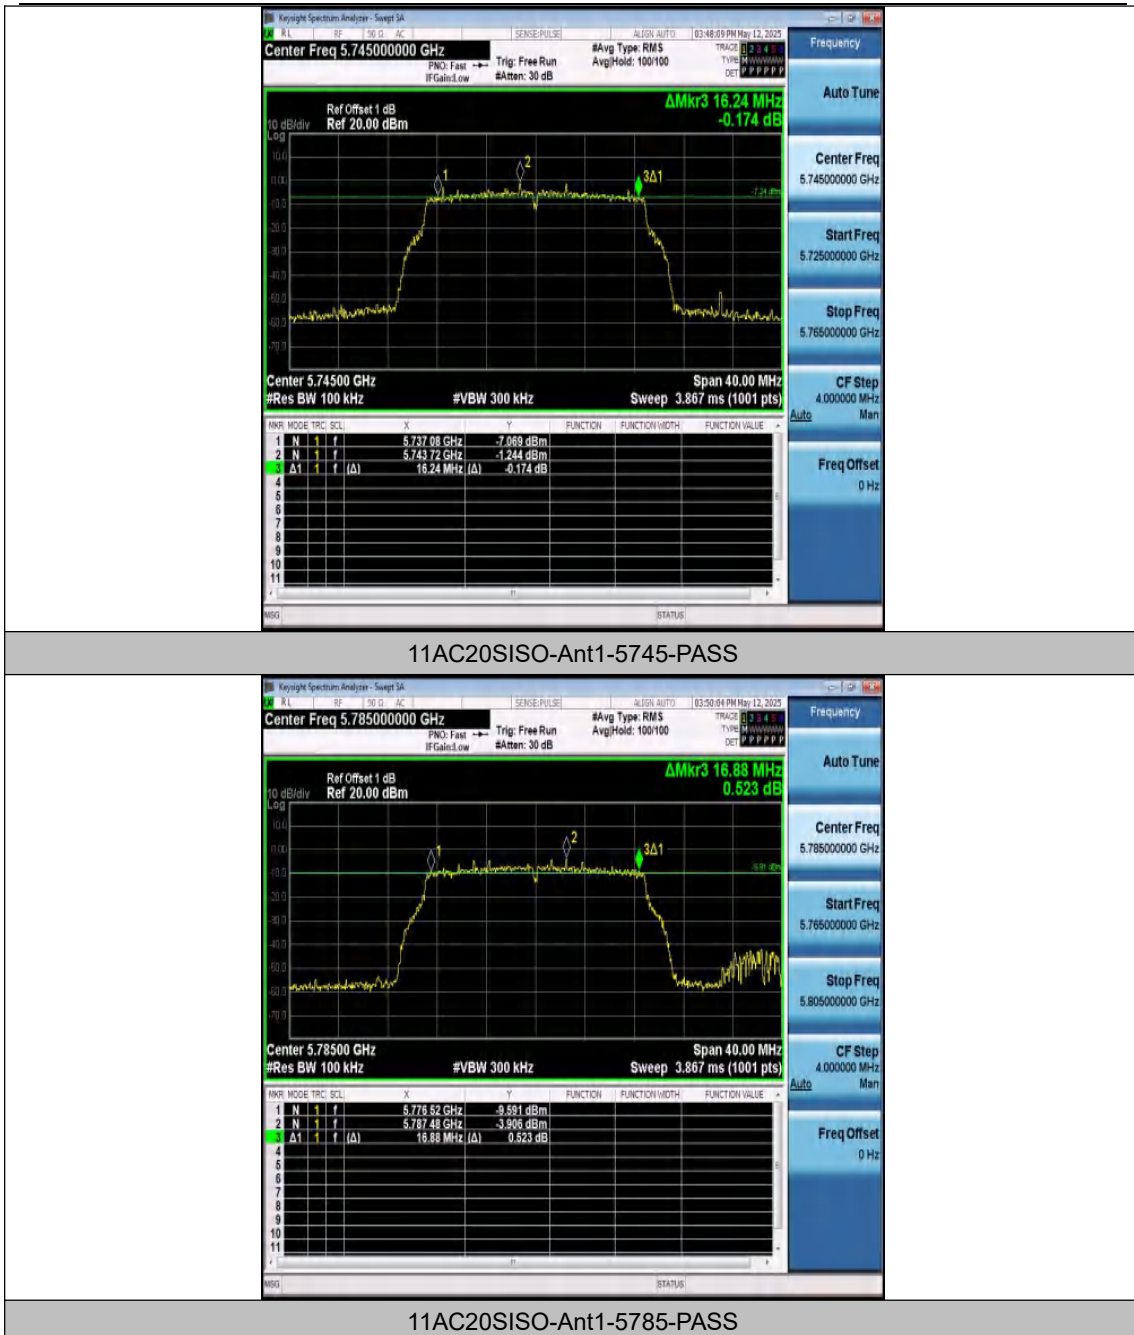

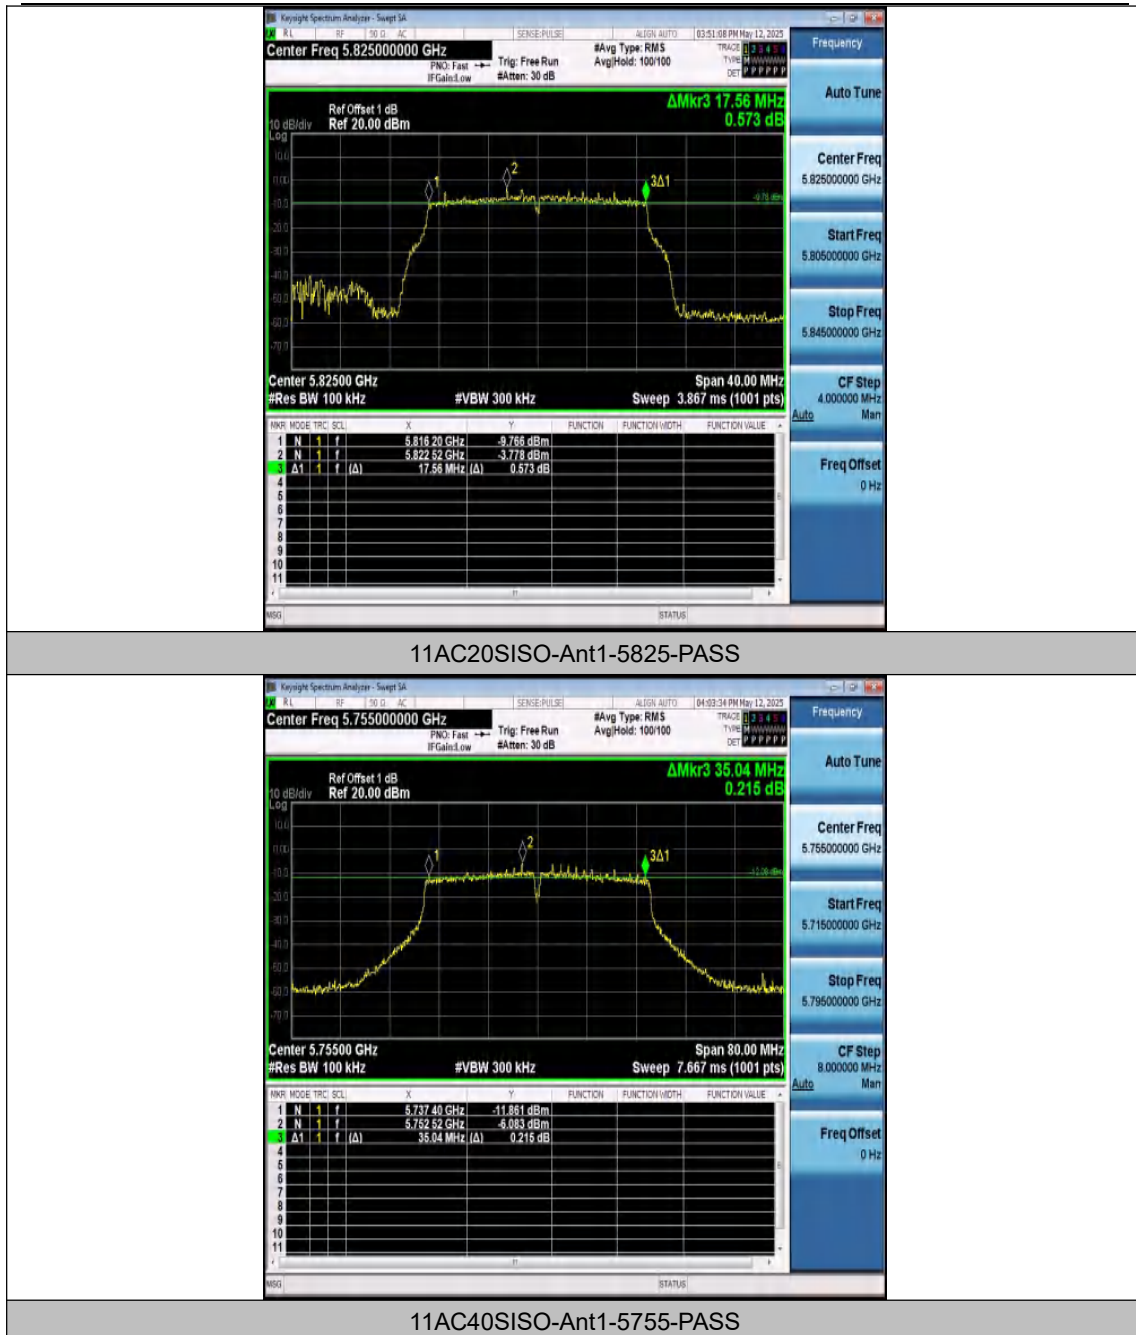

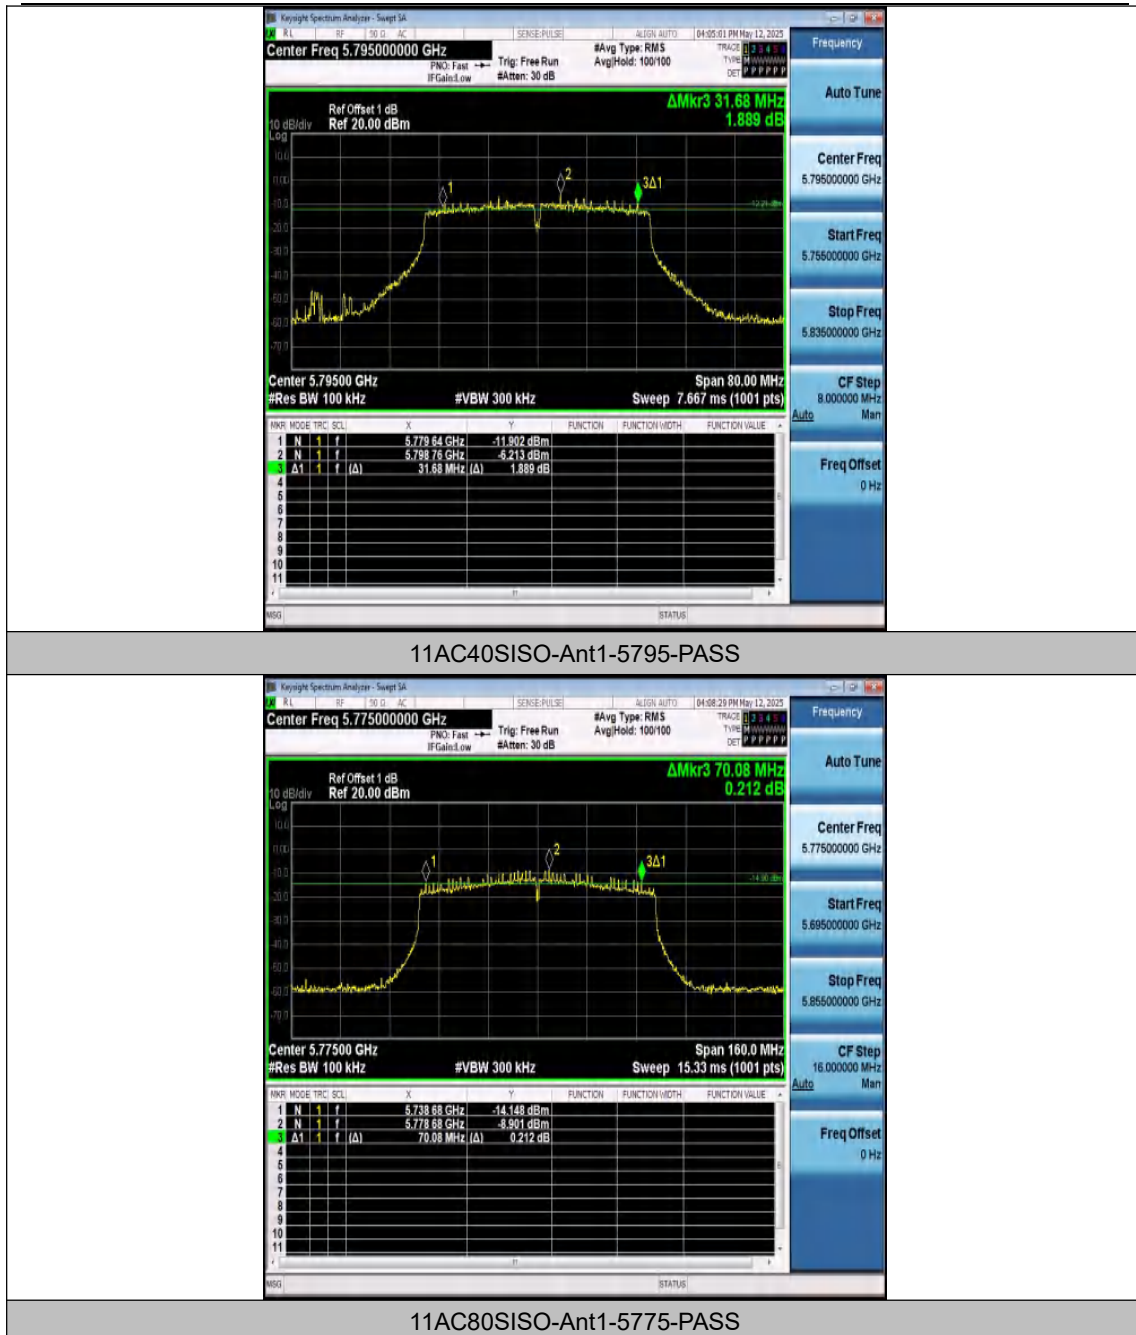


Appendix B: Duty Cycle

Test Result

Test Mode	Antenna	Frequency[MHz]	Transmission Duration [ms]	Transmission Period [ms]	Duty Cycle [%]	Dc Factor [dB]	1/T
11A	Ant1	5180	2.79	2.87	97.21	0.12	0.36
11A	Ant1	5220	2.79	2.87	97.21	0.12	0.36
11A	Ant1	5240	2.79	2.87	97.21	0.12	0.36
11A	Ant1	5745	2.79	2.88	96.88	0.14	0.36
11A	Ant1	5785	2.79	2.87	97.21	0.12	0.36
11A	Ant1	5825	2.79	2.87	97.21	0.12	0.36
11N20SISO	Ant1	5180	2.60	2.68	97.01	0.13	0.38
11N20SISO	Ant1	5220	2.60	2.68	97.01	0.13	0.38
11N20SISO	Ant1	5240	2.60	2.68	97.01	0.13	0.38
11N20SISO	Ant1	5745	2.60	2.68	97.01	0.13	0.38
11N20SISO	Ant1	5785	2.60	2.68	97.01	0.13	0.38
11N20SISO	Ant1	5825	2.60	2.68	97.01	0.13	0.38
11N40SISO	Ant1	5190	2.59	2.68	96.64	0.15	0.39
11N40SISO	Ant1	5230	1.27	1.35	94.07	0.27	0.79
11N40SISO	Ant1	5755	1.27	1.35	94.07	0.27	0.79
11N40SISO	Ant1	5795	1.27	1.35	94.07	0.27	0.79
11AC20SISO	Ant1	5180	2.61	2.86	91.26	0.40	0.38
11AC20SISO	Ant1	5220	2.60	2.69	96.65	0.15	0.38
11AC20SISO	Ant1	5240	2.61	2.69	97.03	0.13	0.38
11AC20SISO	Ant1	5745	2.61	2.69	97.03	0.13	0.38
11AC20SISO	Ant1	5785	2.60	2.69	96.65	0.15	0.38
11AC20SISO	Ant1	5825	2.61	2.69	97.03	0.13	0.38
11AC40SISO	Ant1	5190	1.27	1.35	94.07	0.27	0.79
11AC40SISO	Ant1	5230	1.27	1.36	93.38	0.30	0.79
11AC40SISO	Ant1	5755	1.28	1.36	94.12	0.26	0.78
11AC40SISO	Ant1	5795	1.28	1.36	94.12	0.26	0.78
11AC80SISO	Ant1	5210	0.61	0.70	87.14	0.60	1.64
11AC80SISO	Ant1	5775	0.61	0.69	88.41	0.53	1.64


Test Graphs

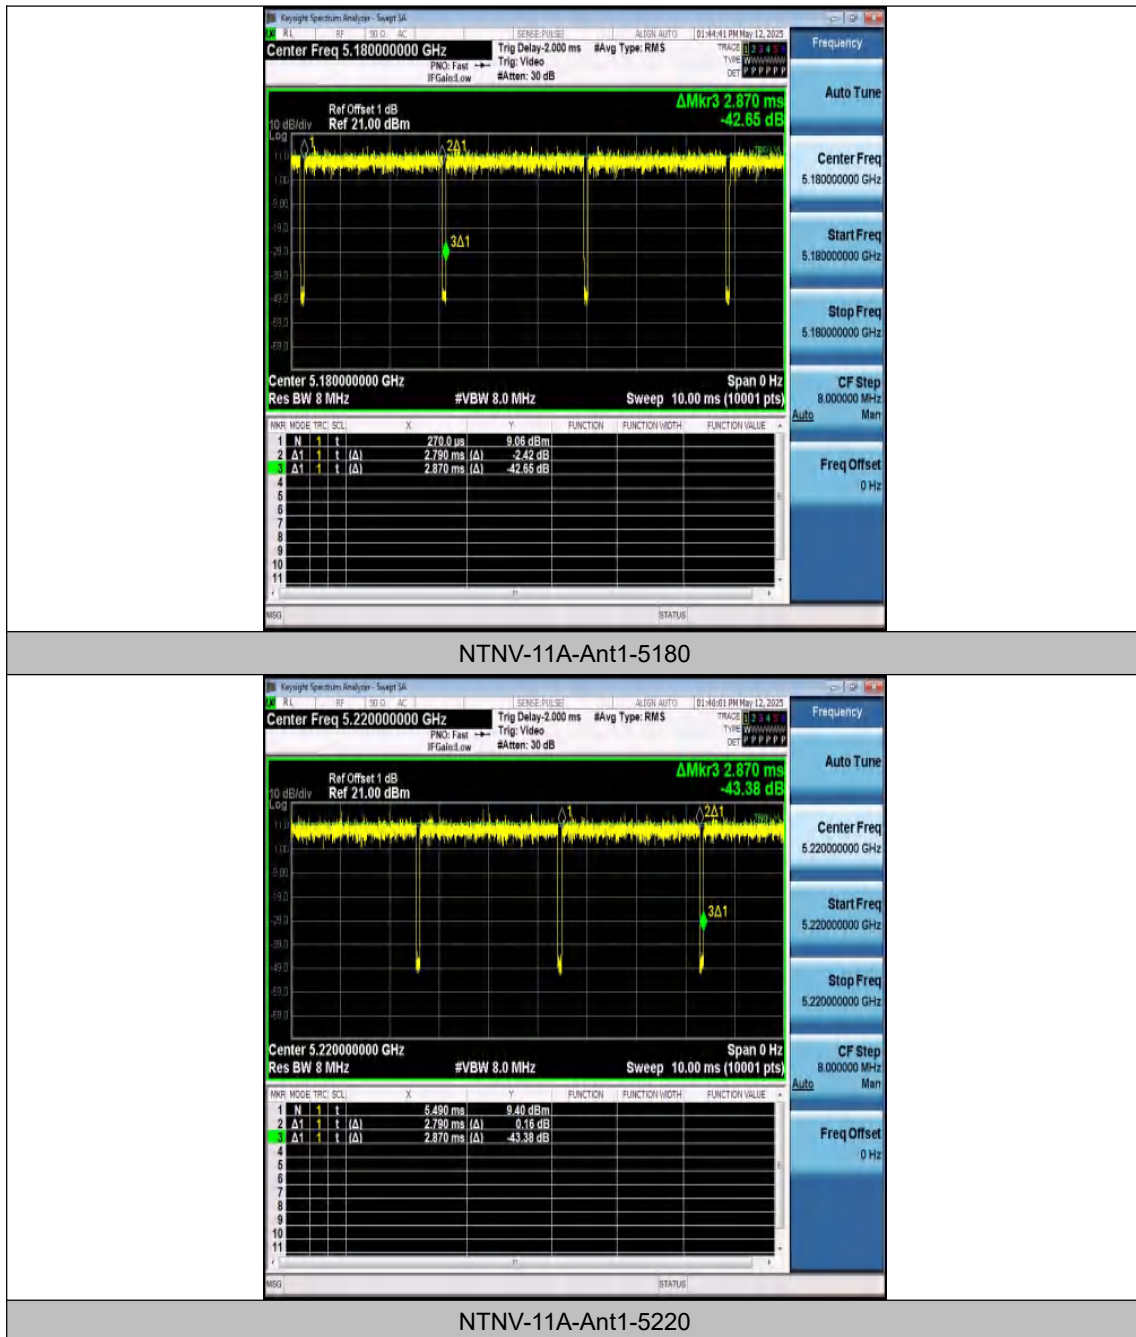



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

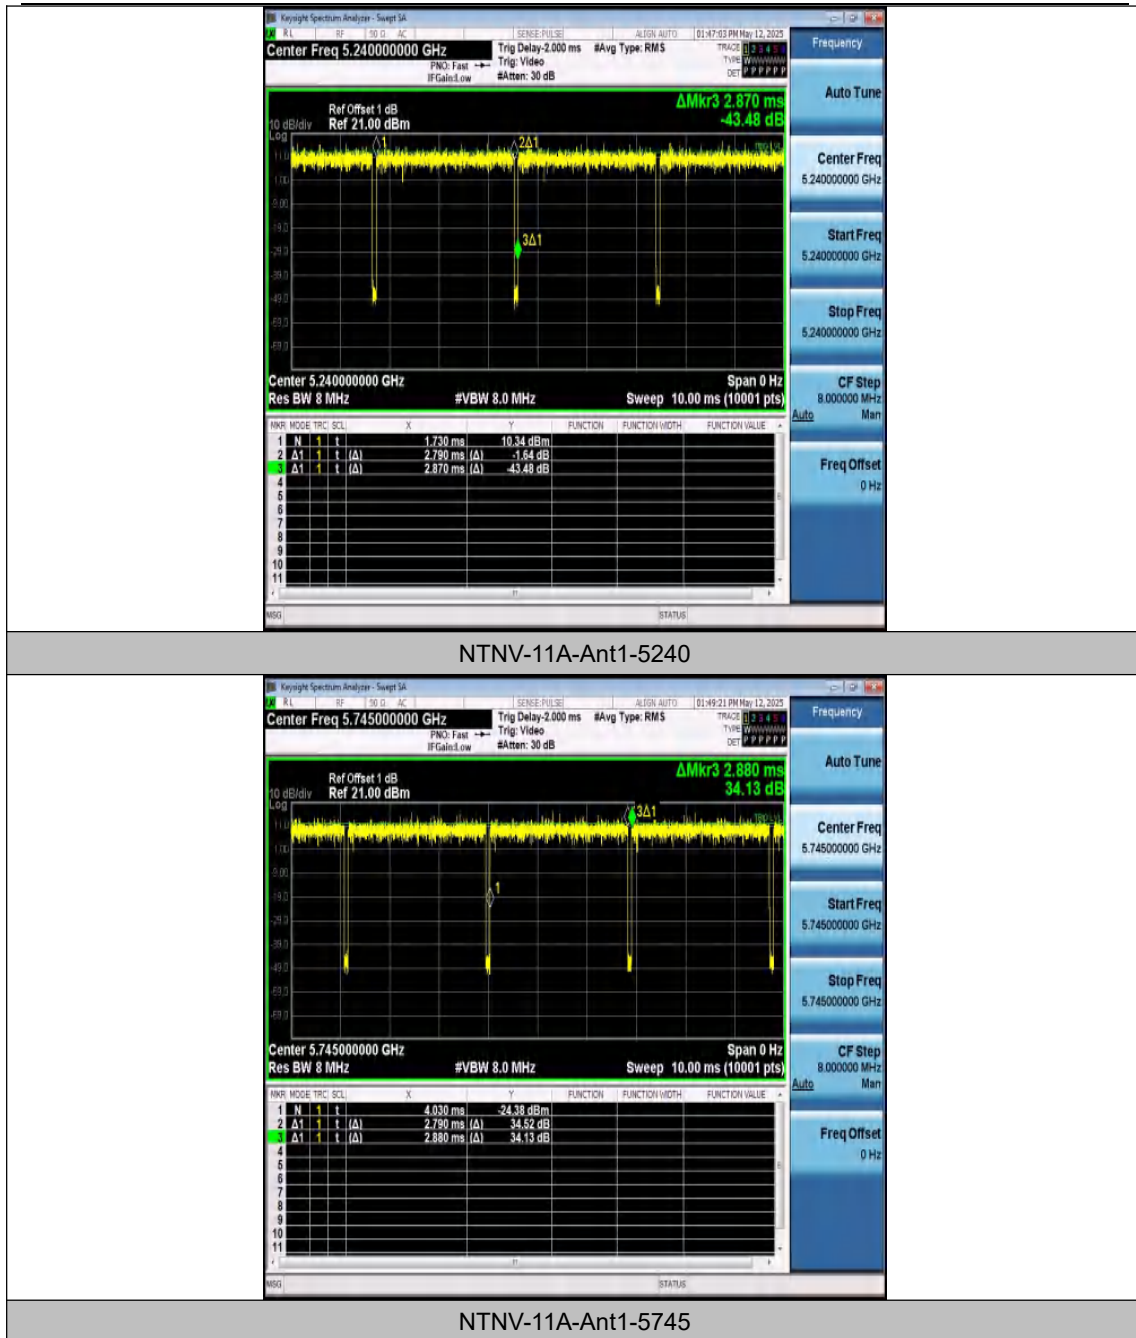

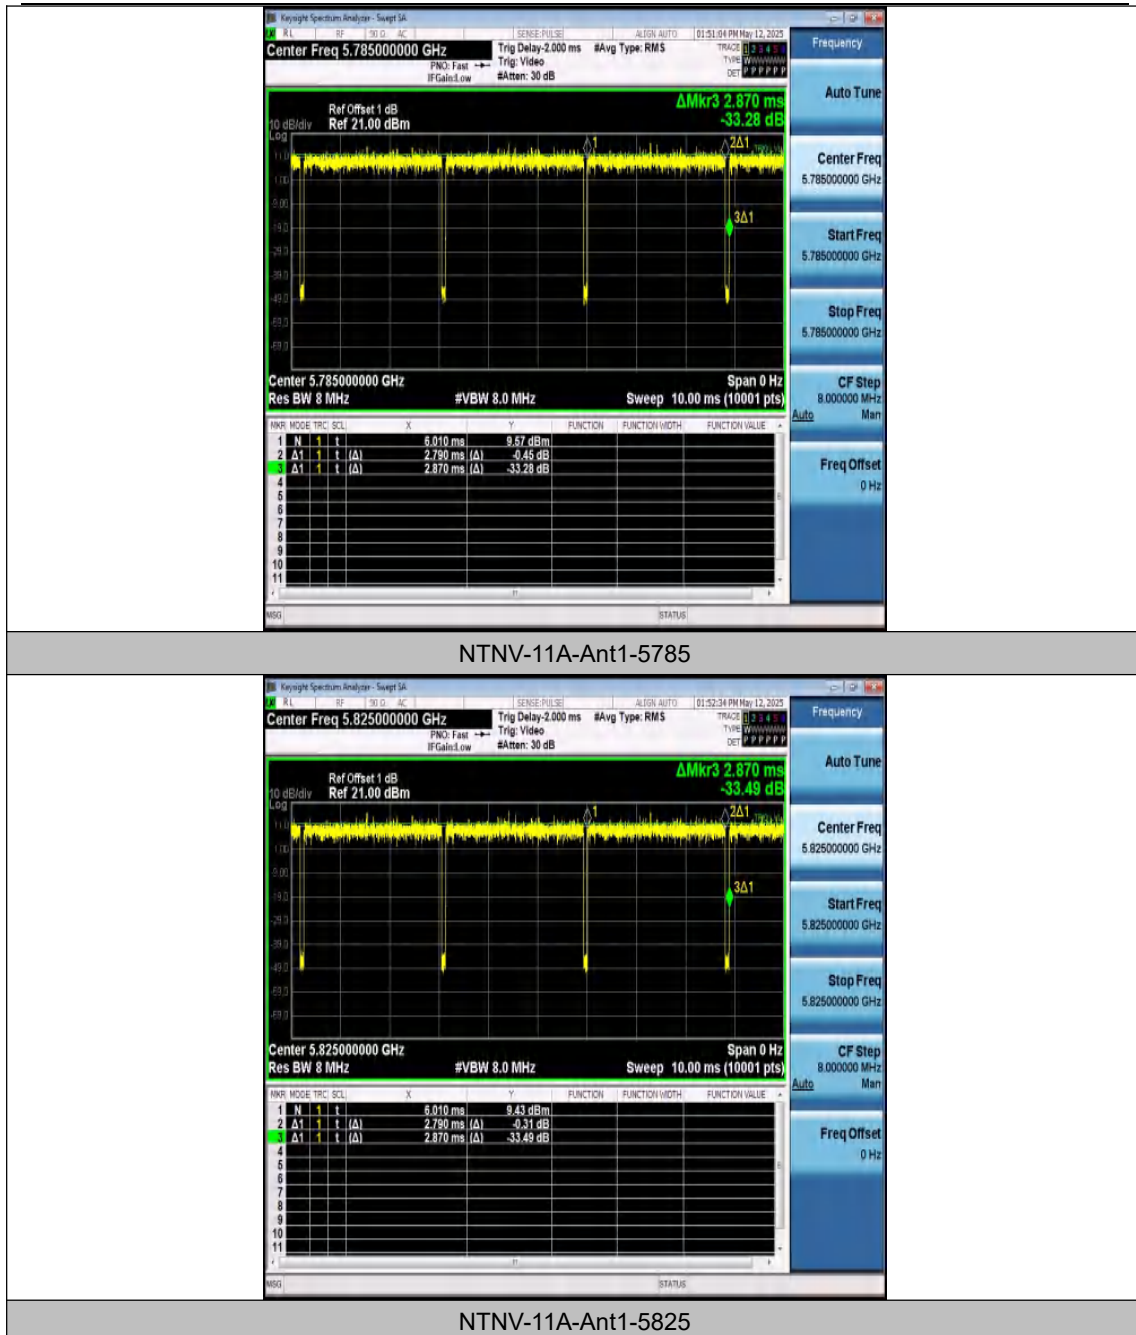


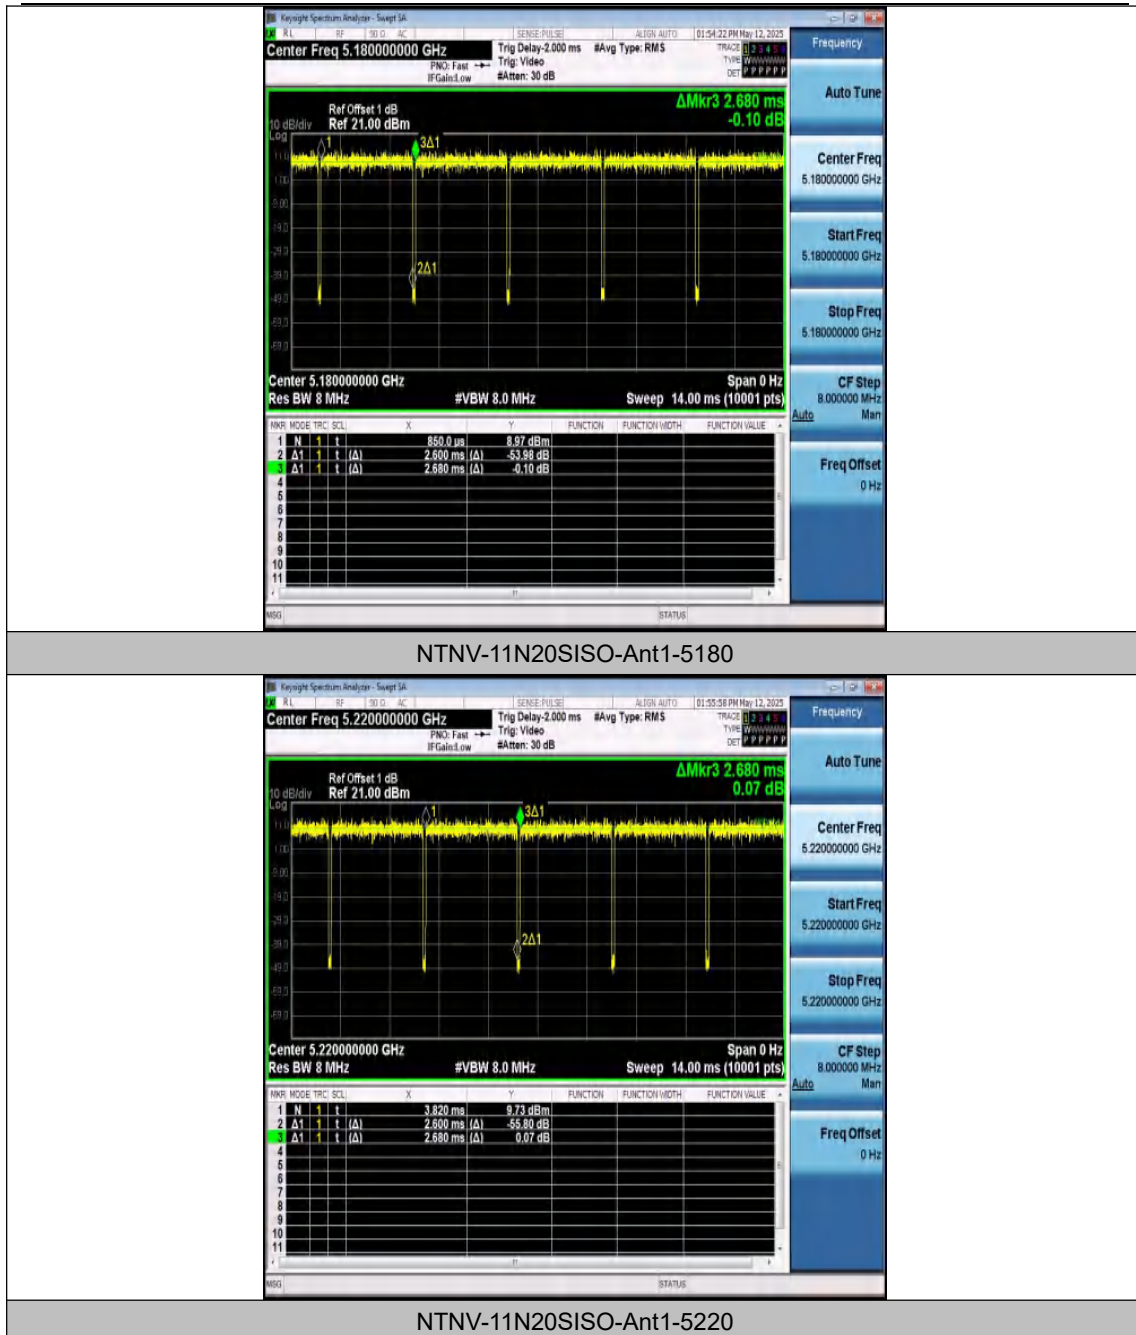



Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

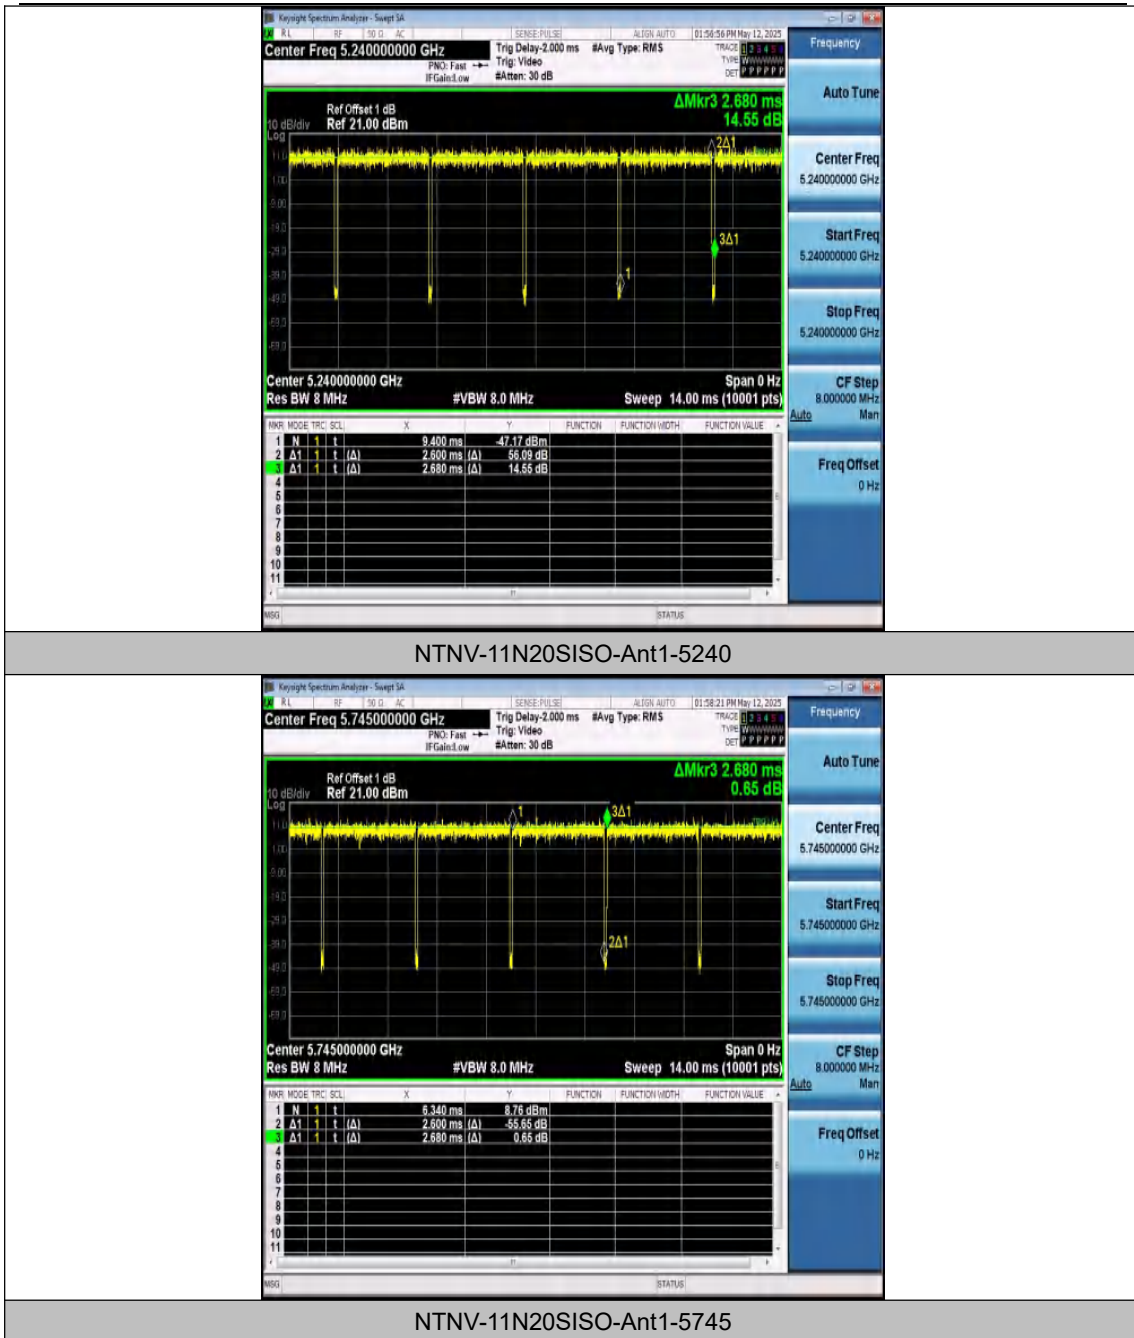

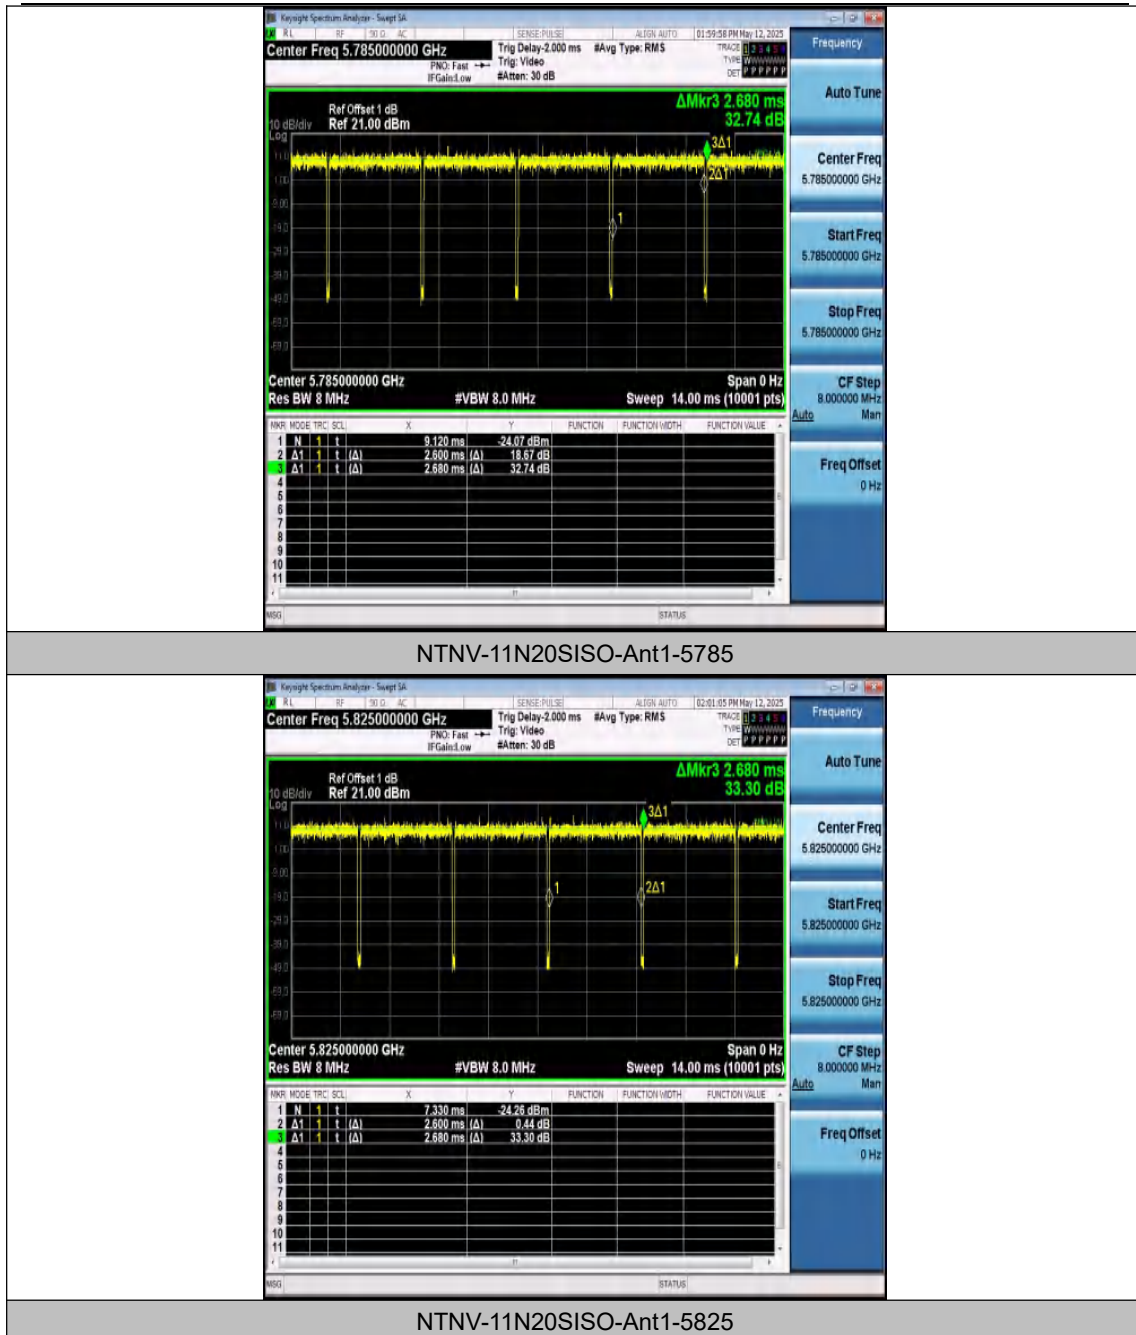


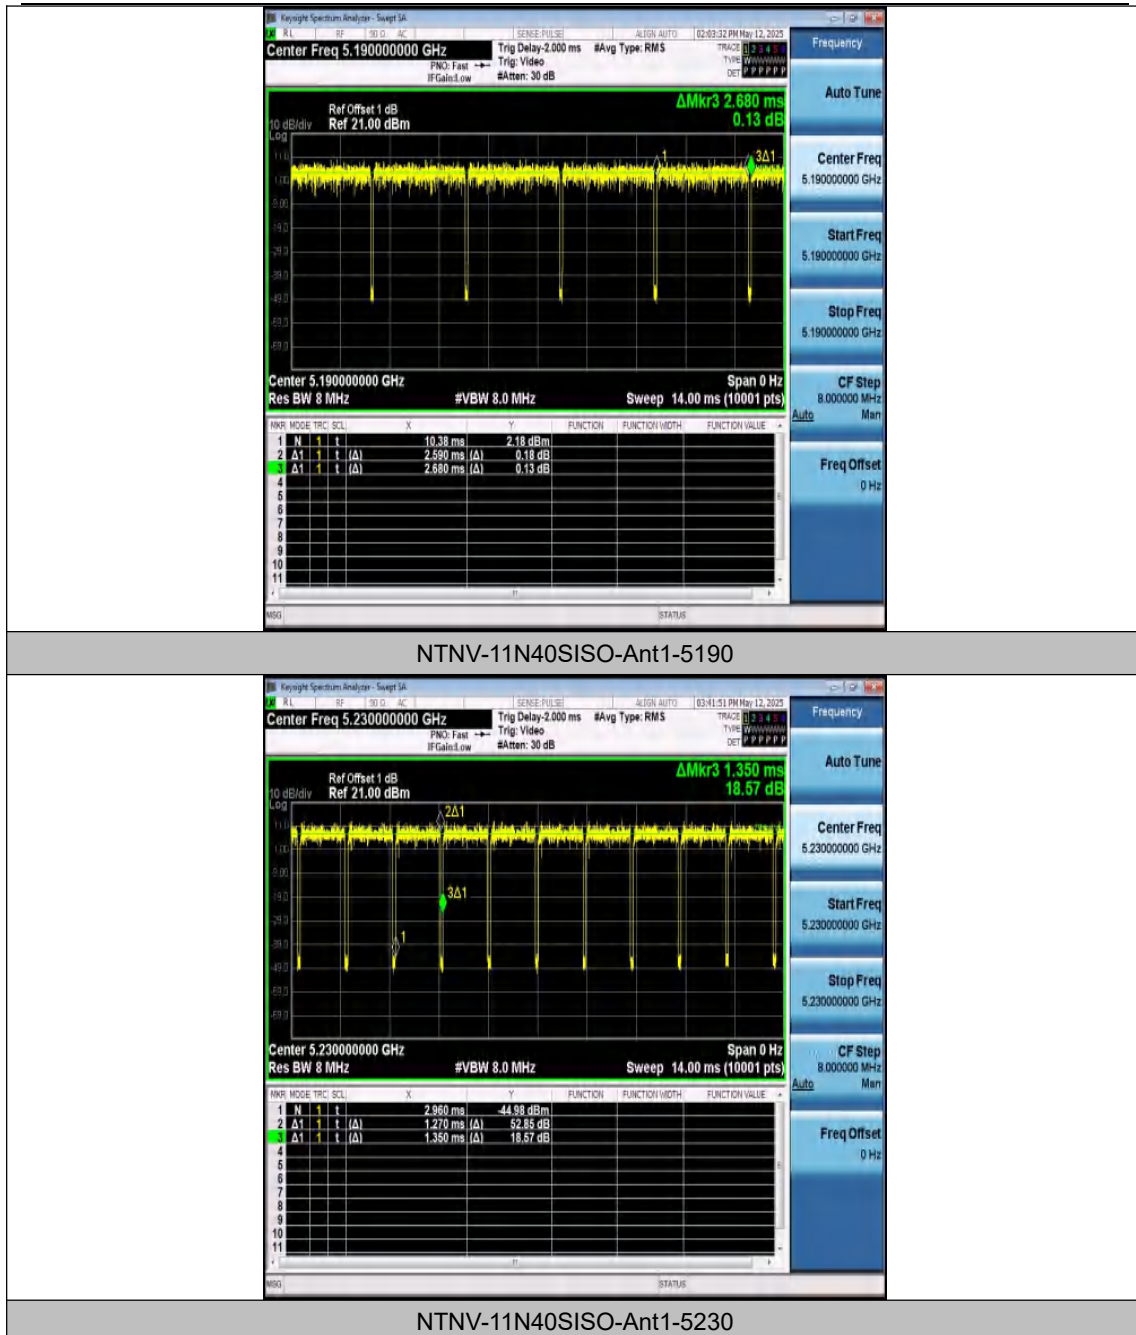

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

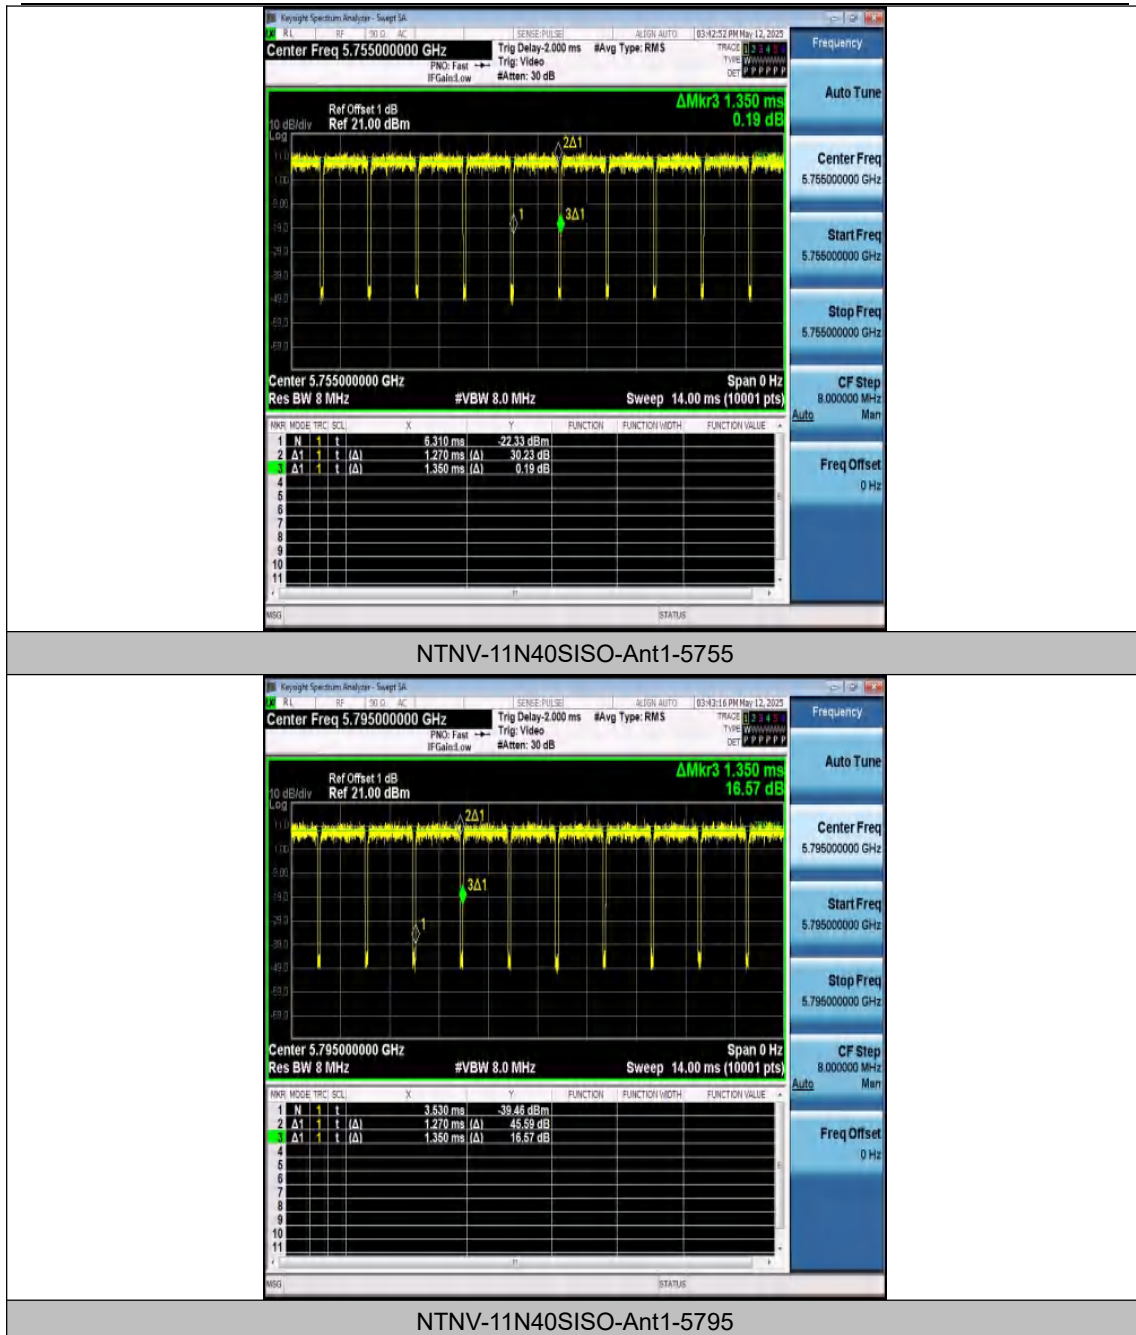



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

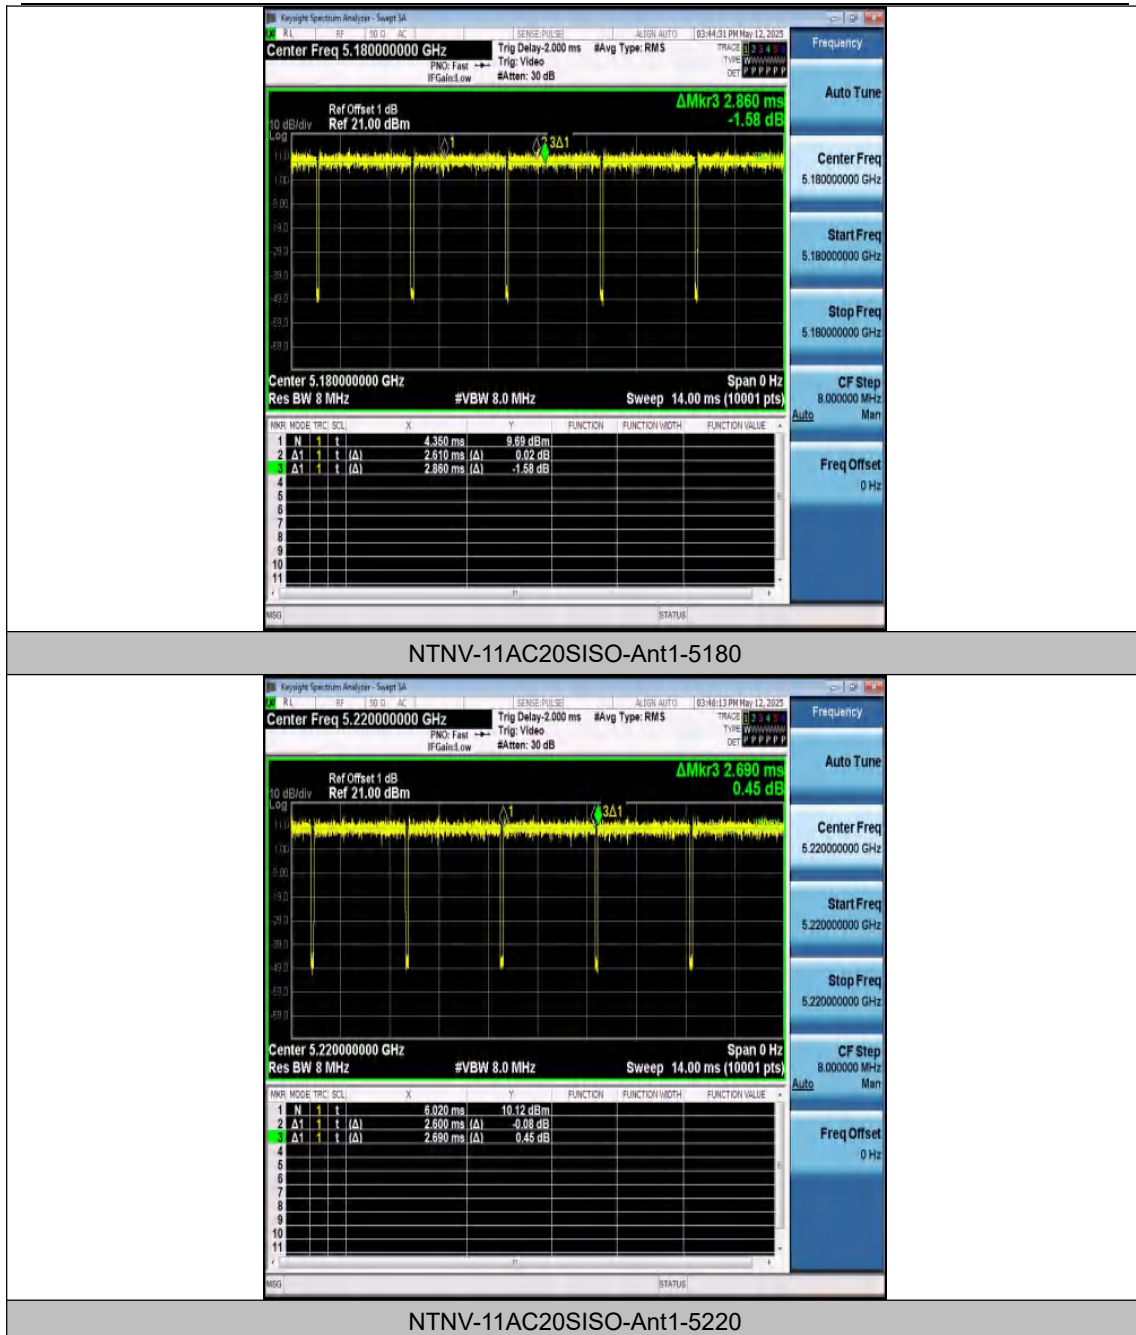


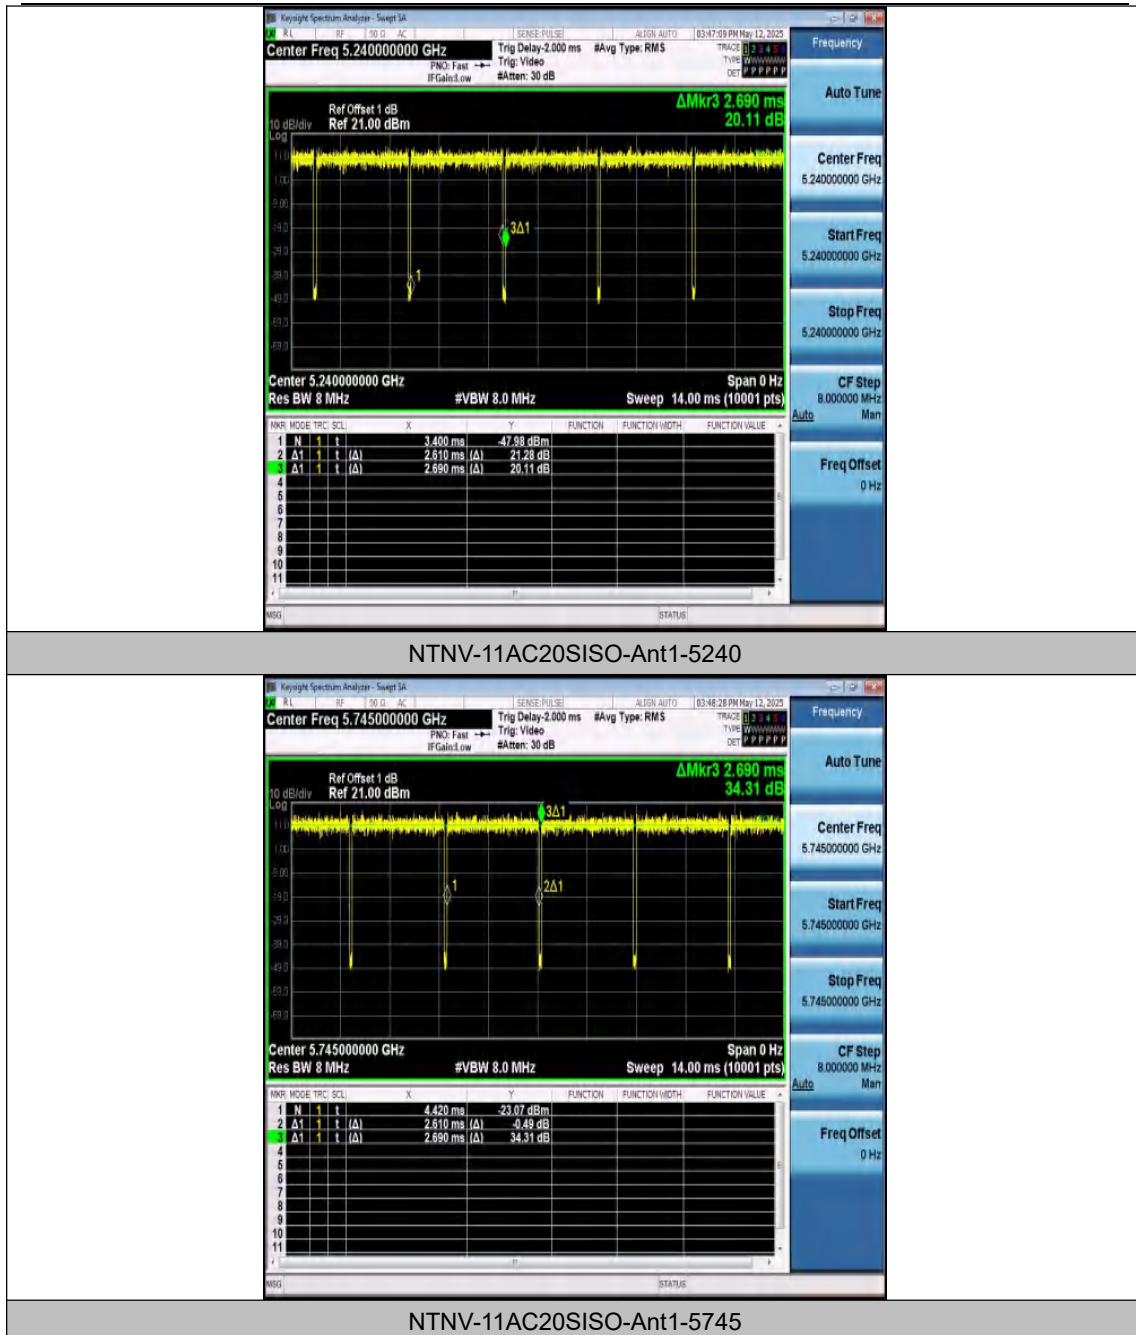

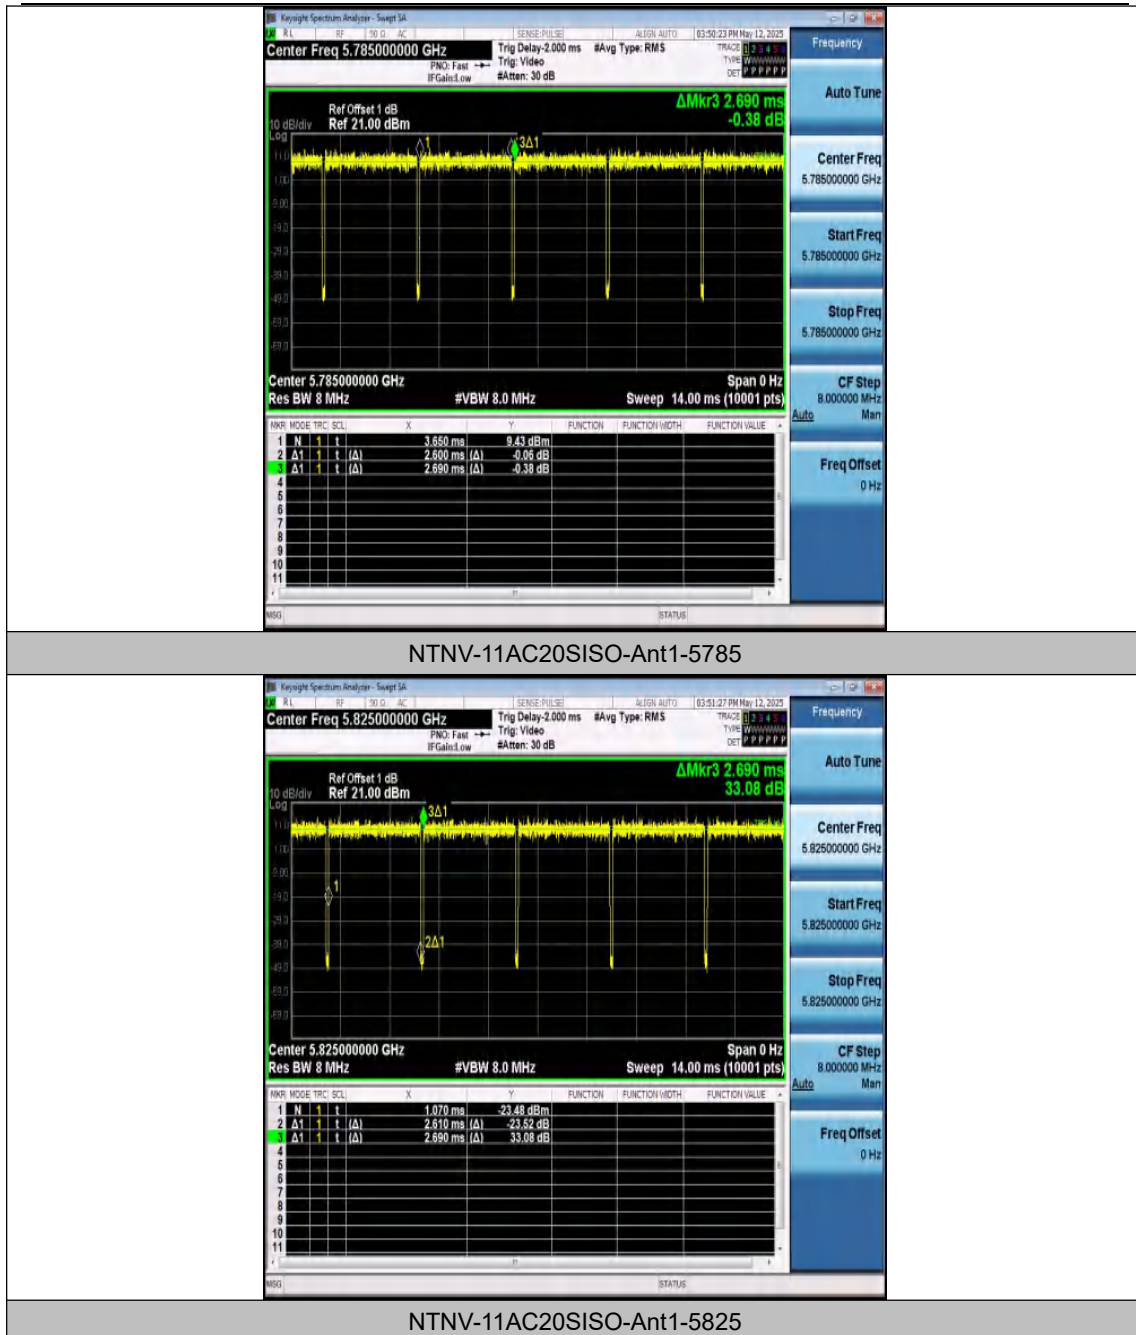

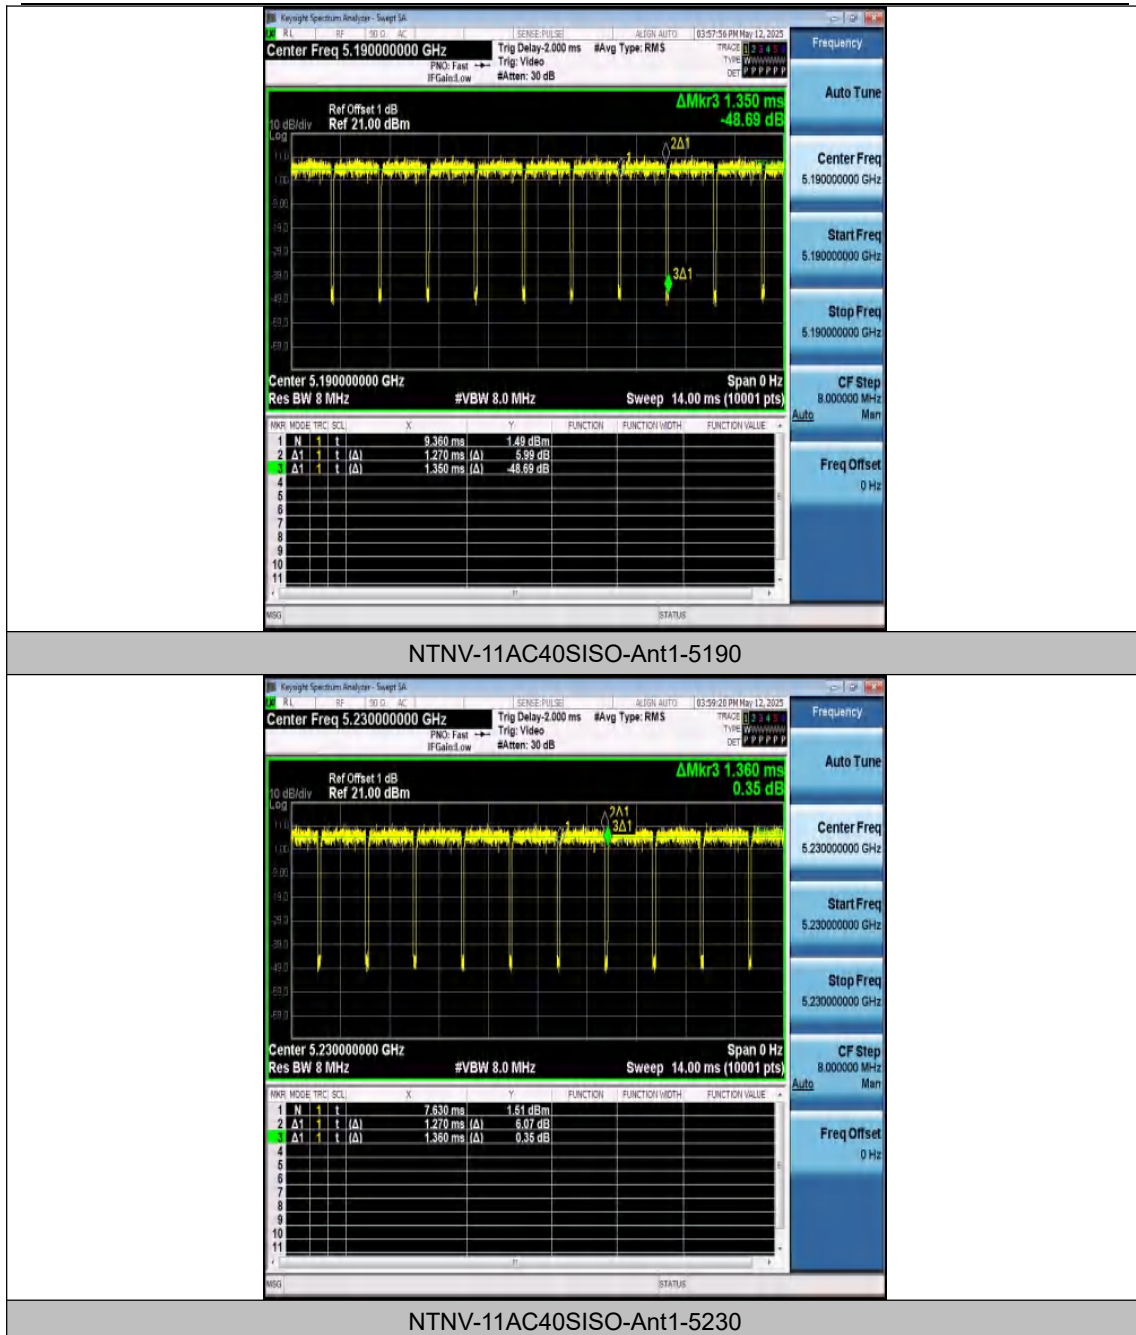

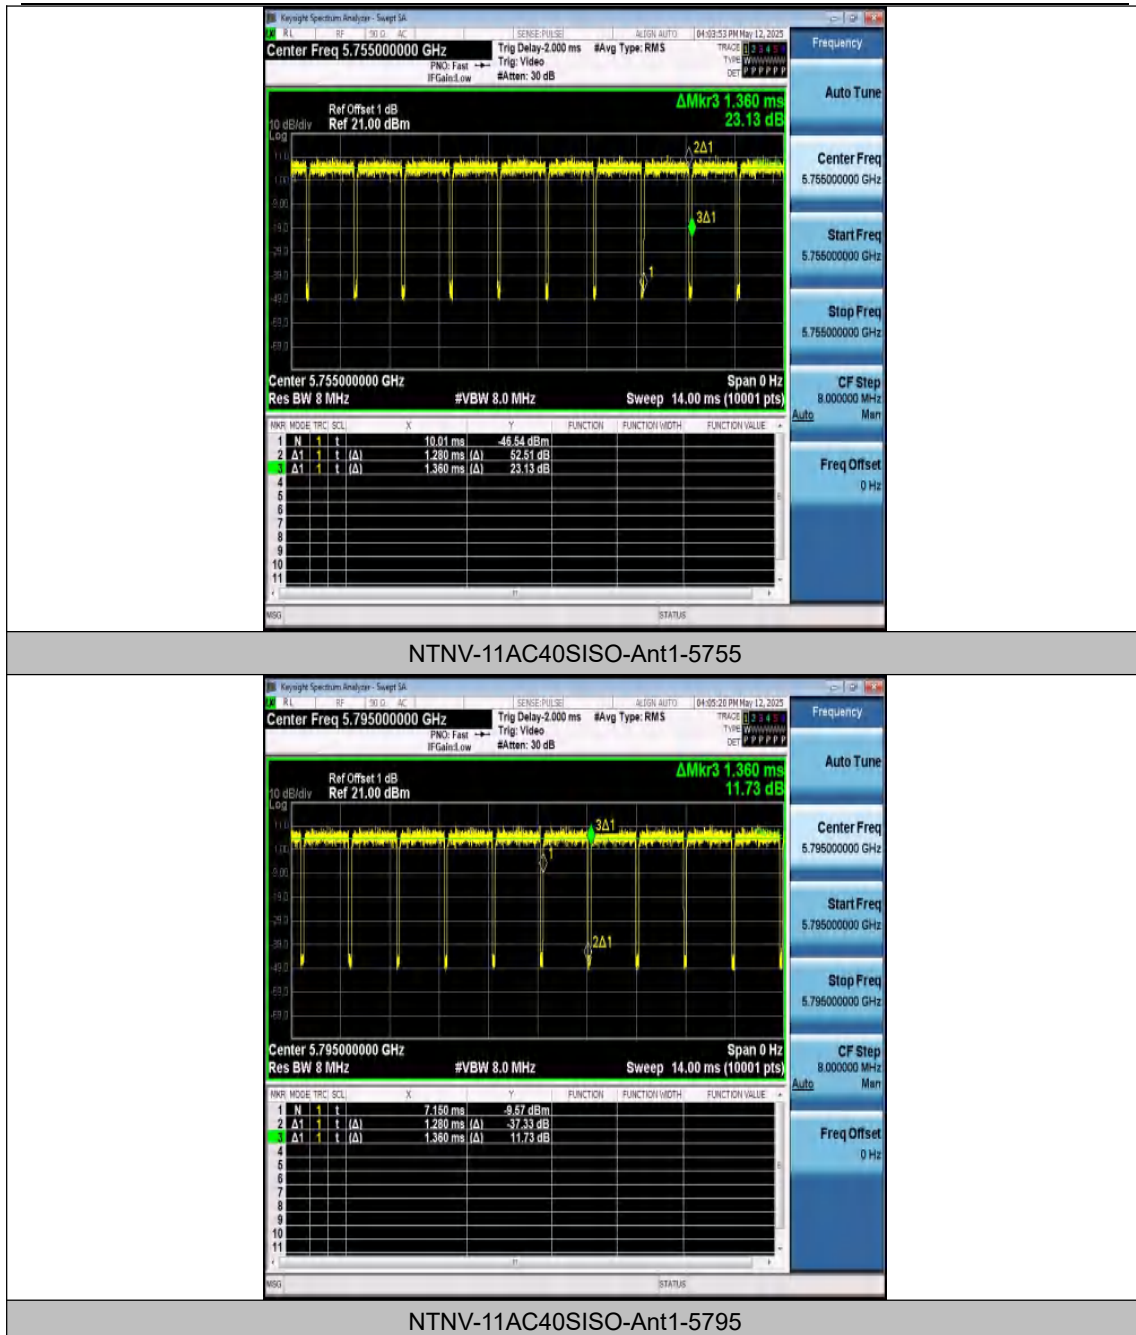

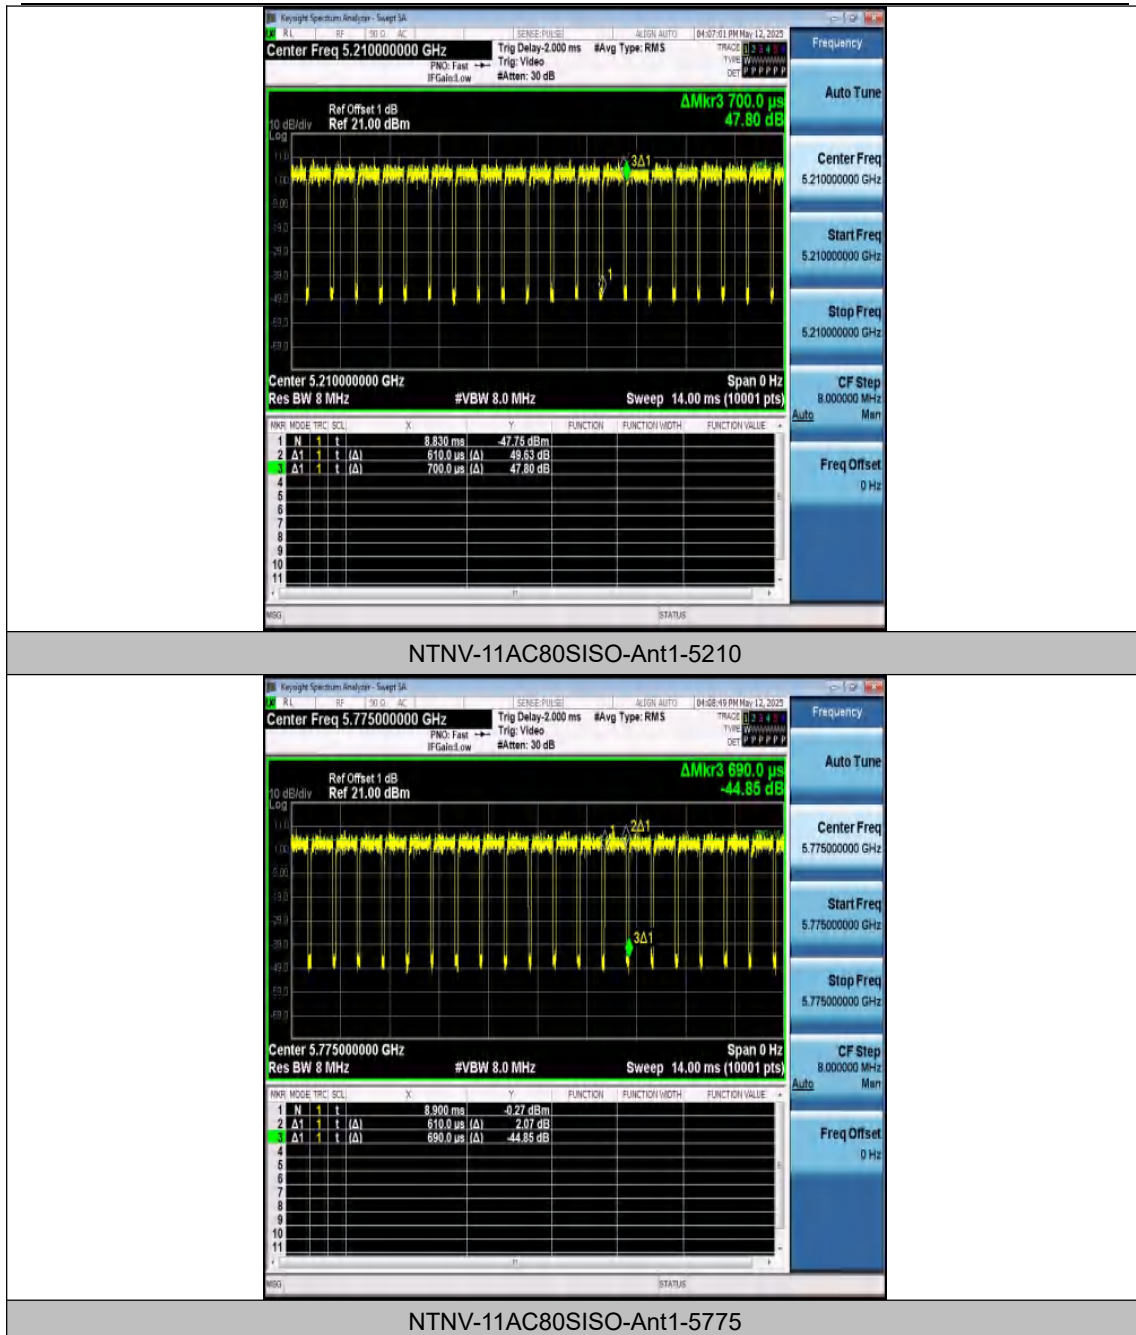


Appendix C: Maximum Conducted Output Power

Test Result Channel Power

Test Mode	Antenna	Frequency[MHz]	Channel Power [dBm]	Duty Cycle [%]	DC Factor [dB]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	5180	11.42	97.21	0.12	11.54	≤23.98	PASS
11A	Ant1	5220	12.29	97.21	0.12	12.41	≤23.98	PASS
11A	Ant1	5240	12.33	97.21	0.12	12.45	≤23.98	PASS
11A	Ant1	5745	12.04	96.88	0.14	12.18	≤30.00	PASS
11A	Ant1	5785	11.91	97.21	0.12	12.03	≤30.00	PASS
11A	Ant1	5825	11.95	97.21	0.12	12.07	≤30.00	PASS
11N20SISO	Ant1	5180	11.58	97.01	0.13	11.71	≤23.98	PASS
11N20SISO	Ant1	5220	12.59	97.01	0.13	12.72	≤23.98	PASS
11N20SISO	Ant1	5240	12.64	97.01	0.13	12.77	≤23.98	PASS
11N20SISO	Ant1	5745	11.70	97.01	0.13	11.83	≤30.00	PASS
11N20SISO	Ant1	5785	11.57	97.01	0.13	11.70	≤30.00	PASS
11N20SISO	Ant1	5825	11.71	97.01	0.13	11.84	≤30.00	PASS
11N40SISO	Ant1	5190	11.60	96.64	0.15	11.75	≤23.98	PASS
11N40SISO	Ant1	5230	12.27	94.07	0.27	12.54	≤23.98	PASS
11N40SISO	Ant1	5755	11.66	94.07	0.27	11.93	≤30.00	PASS
11N40SISO	Ant1	5795	11.47	94.07	0.27	11.74	≤30.00	PASS
11AC20SISO	Ant1	5180	11.79	91.26	0.40	12.19	≤23.98	PASS
11AC20SISO	Ant1	5220	12.29	96.65	0.15	12.44	≤23.98	PASS
11AC20SISO	Ant1	5240	12.33	97.03	0.13	12.46	≤23.98	PASS
11AC20SISO	Ant1	5745	11.90	97.03	0.13	12.03	≤30.00	PASS
11AC20SISO	Ant1	5785	11.77	96.65	0.15	11.92	≤30.00	PASS
11AC20SISO	Ant1	5825	12.33	97.03	0.13	12.46	≤30.00	PASS
11AC40SISO	Ant1	5190	11.61	94.07	0.27	11.88	≤23.98	PASS
11AC40SISO	Ant1	5230	11.82	93.38	0.30	12.12	≤23.98	PASS
11AC40SISO	Ant1	5755	11.68	94.12	0.26	11.94	≤30.00	PASS
11AC40SISO	Ant1	5795	11.51	94.12	0.26	11.77	≤30.00	PASS
11AC80SISO	Ant1	5210	11.76	87.14	0.60	12.36	≤23.98	PASS
11AC80SISO	Ant1	5775	11.11	88.41	0.53	11.64	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.


Test Graphs Channel Power

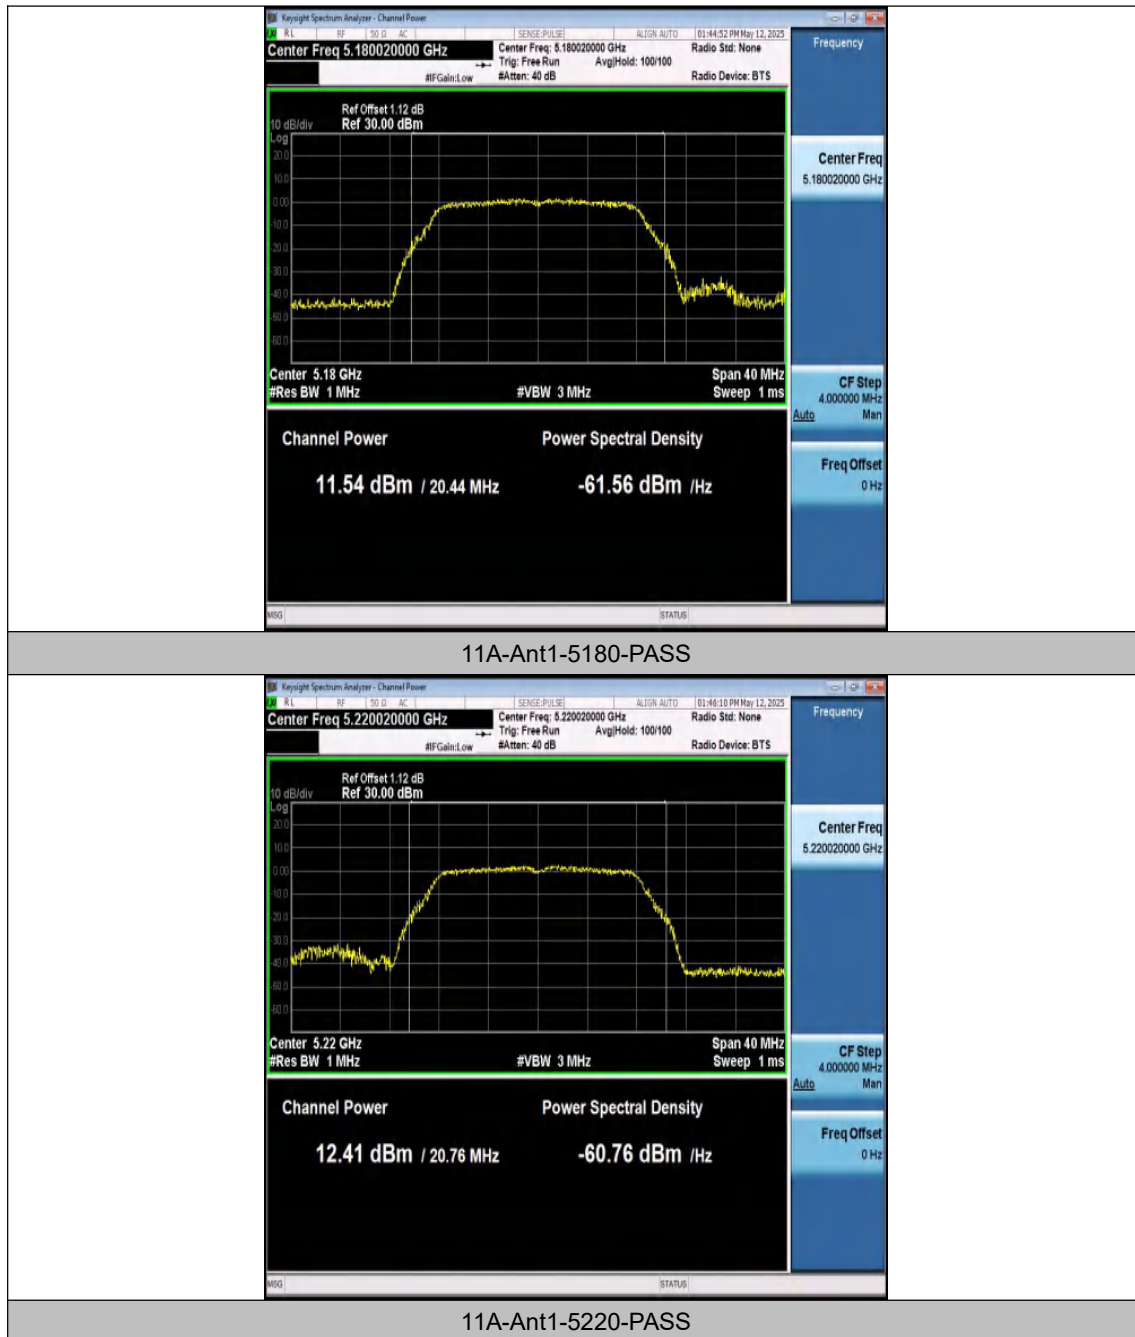



Shenzhen Anbotech Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

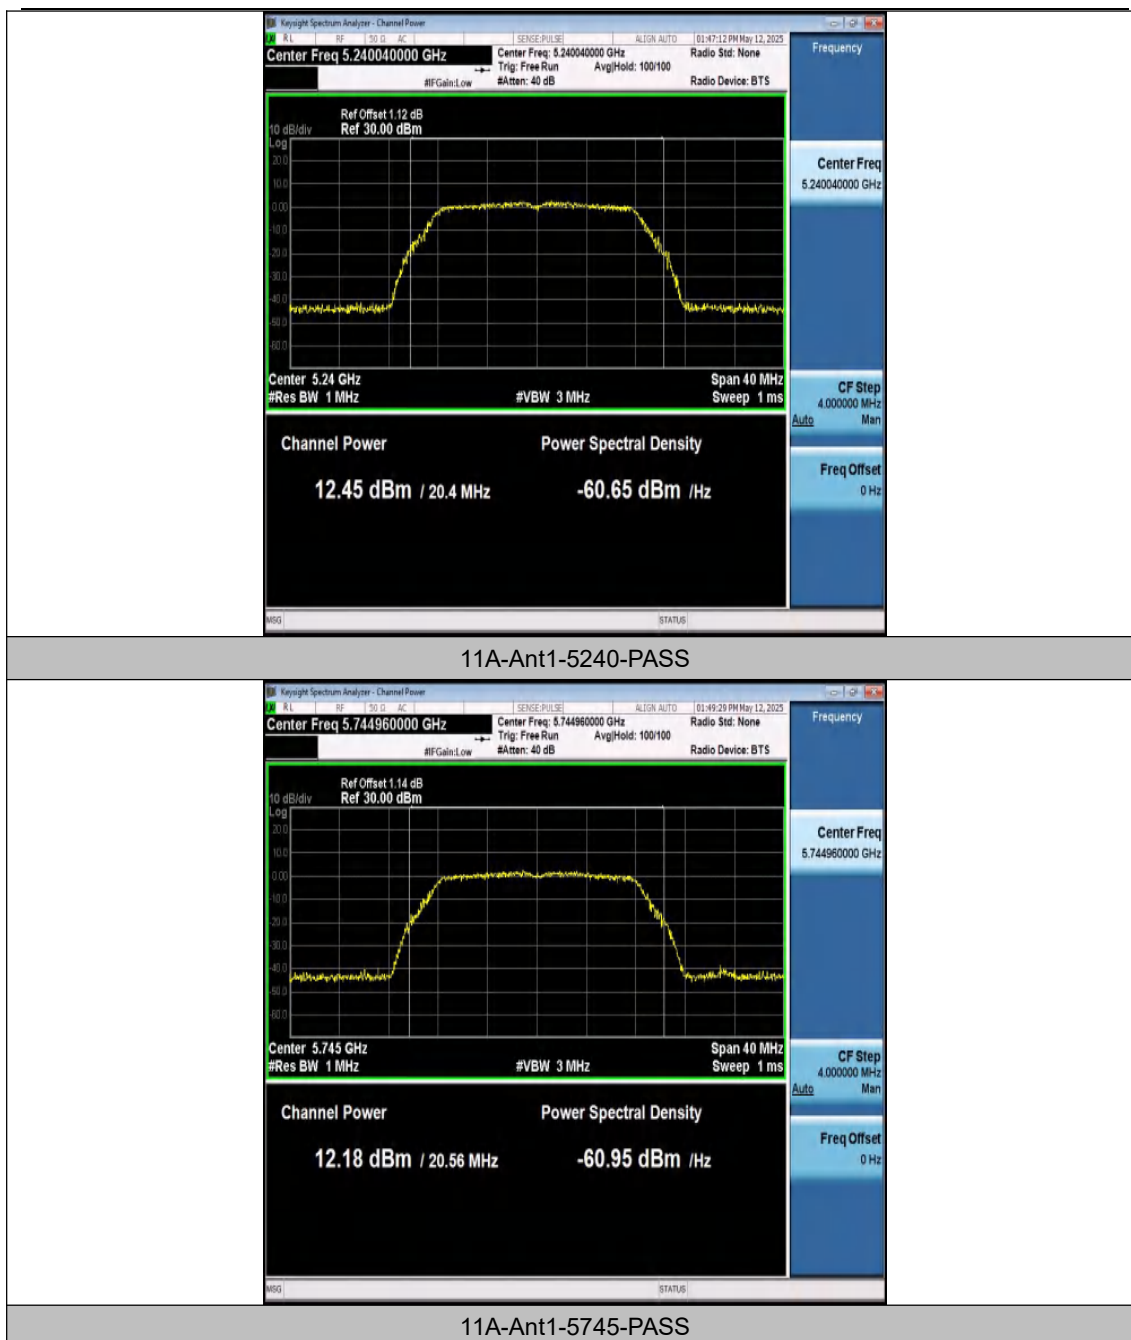


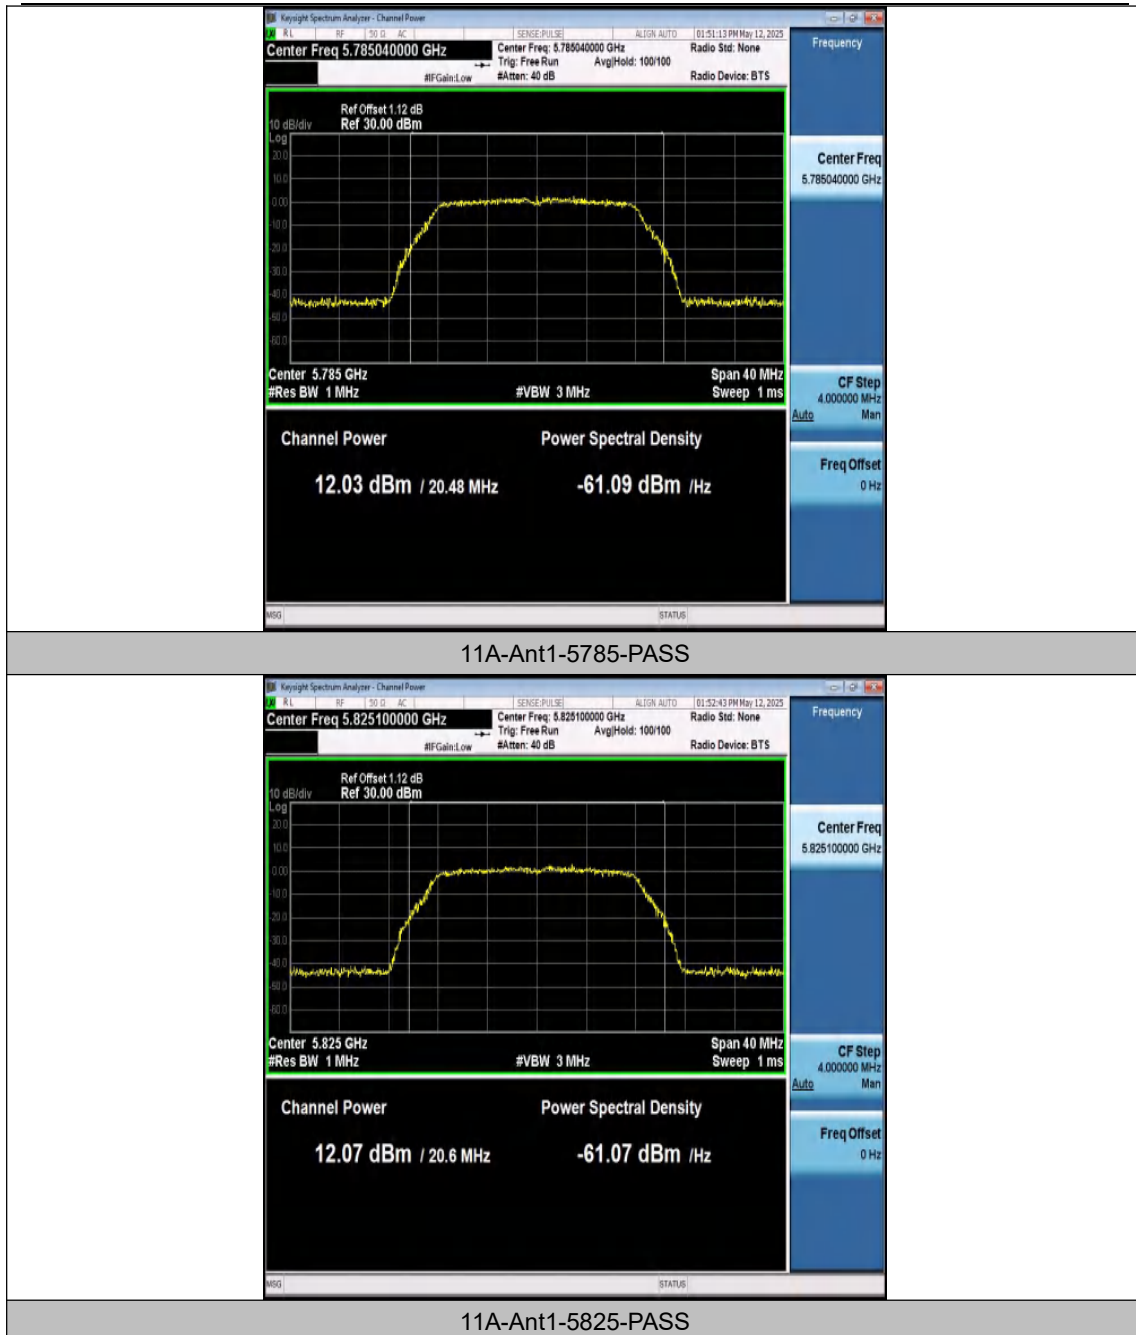


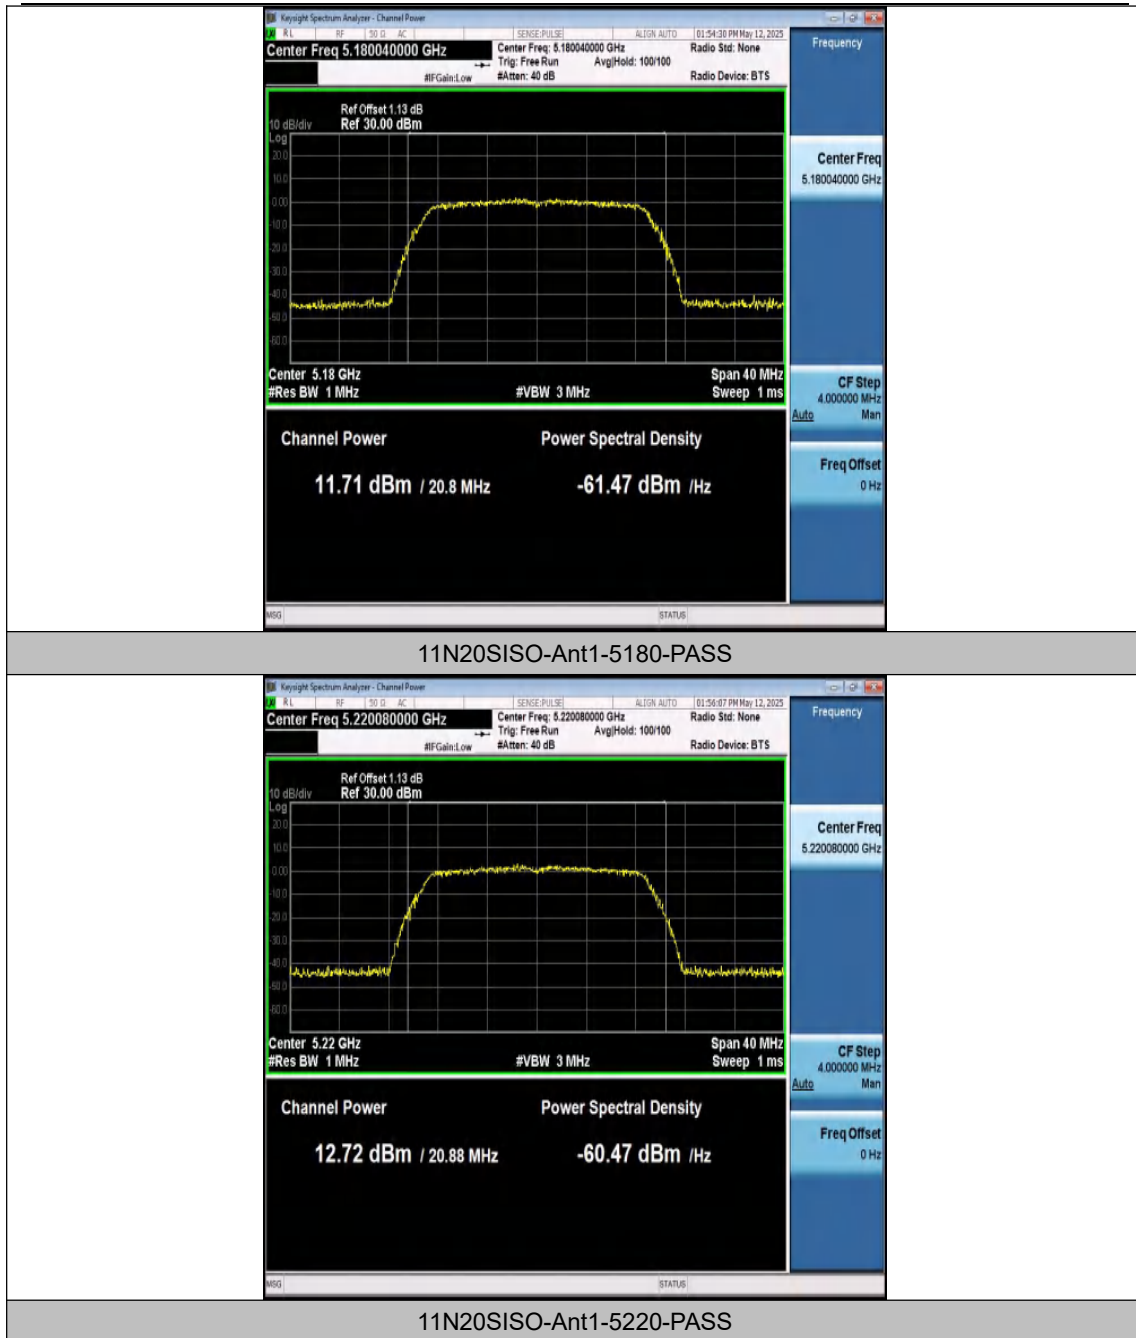


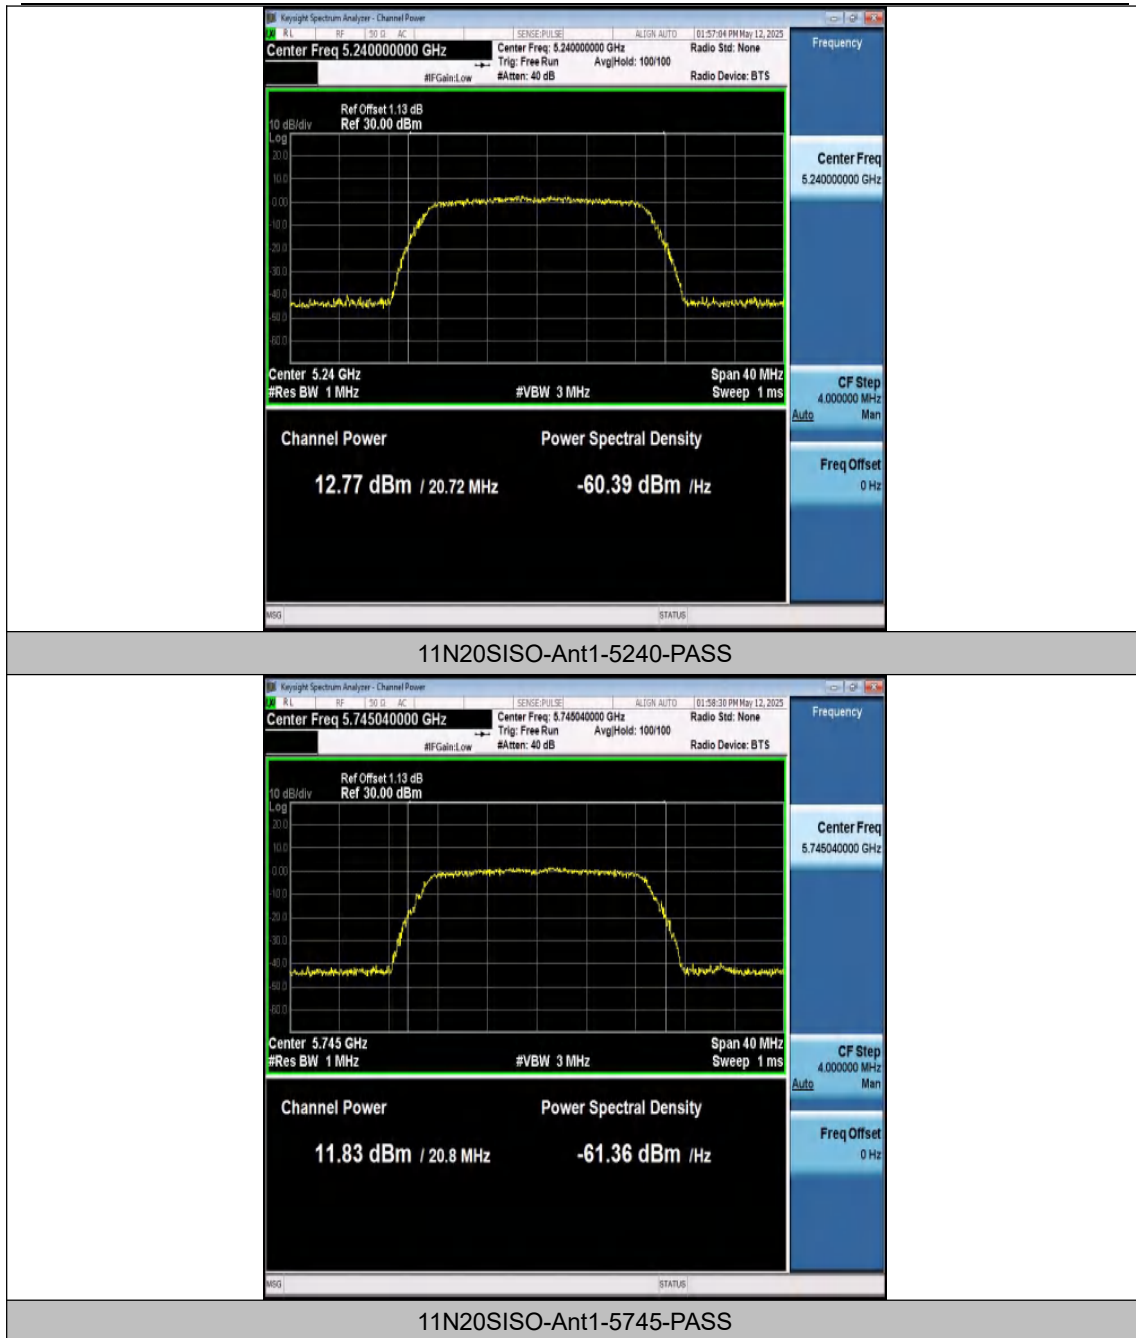


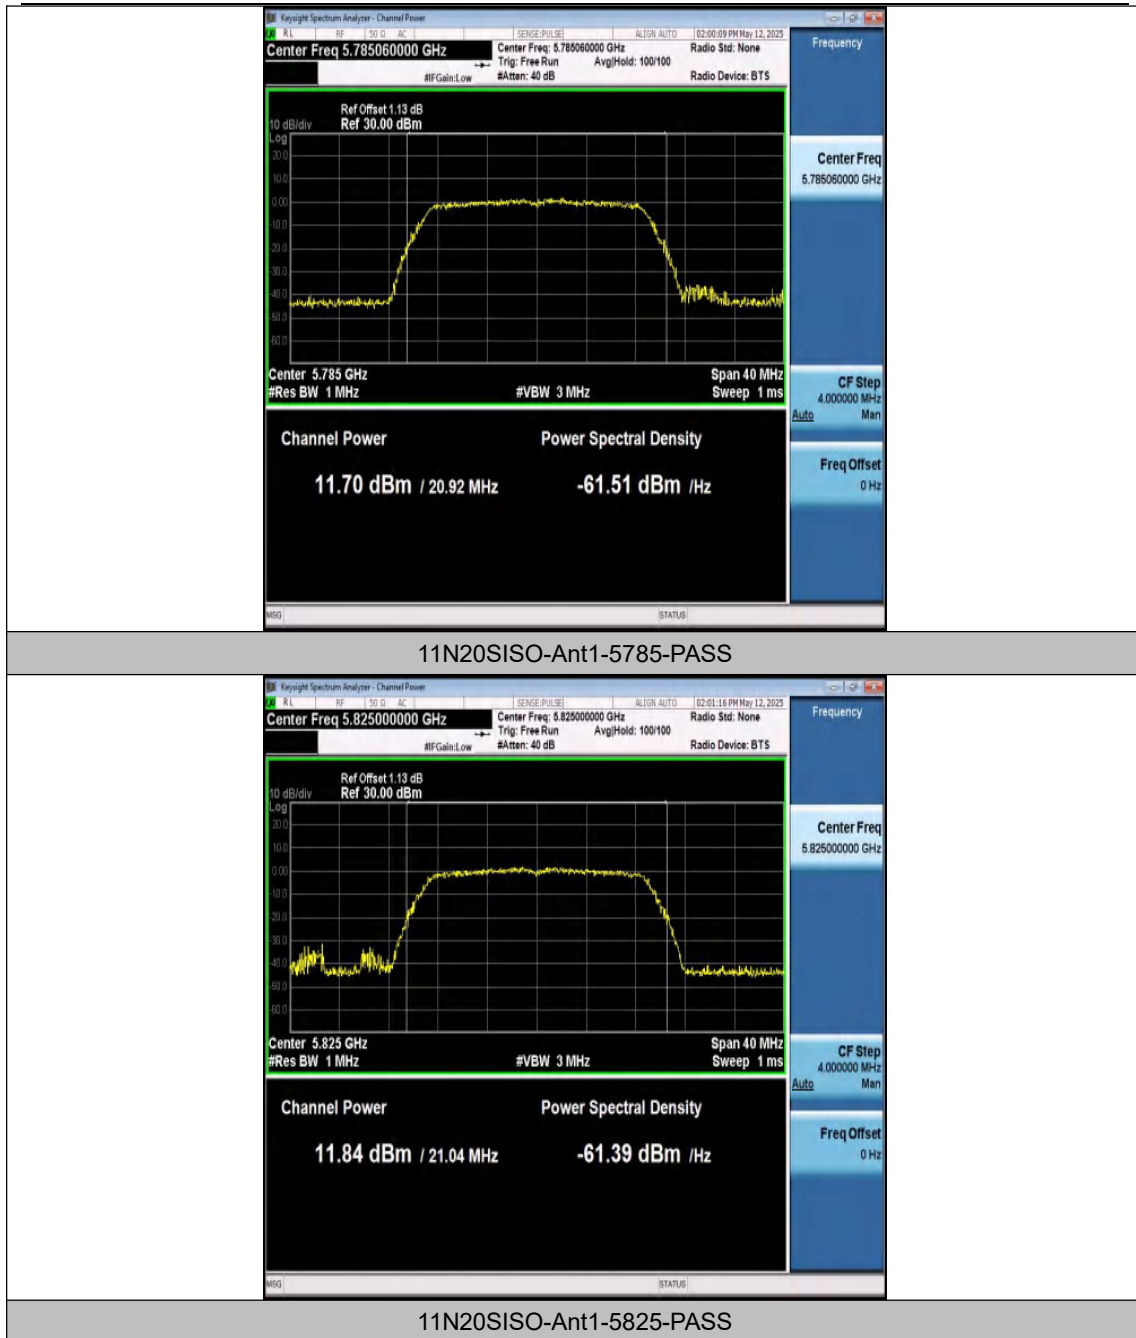


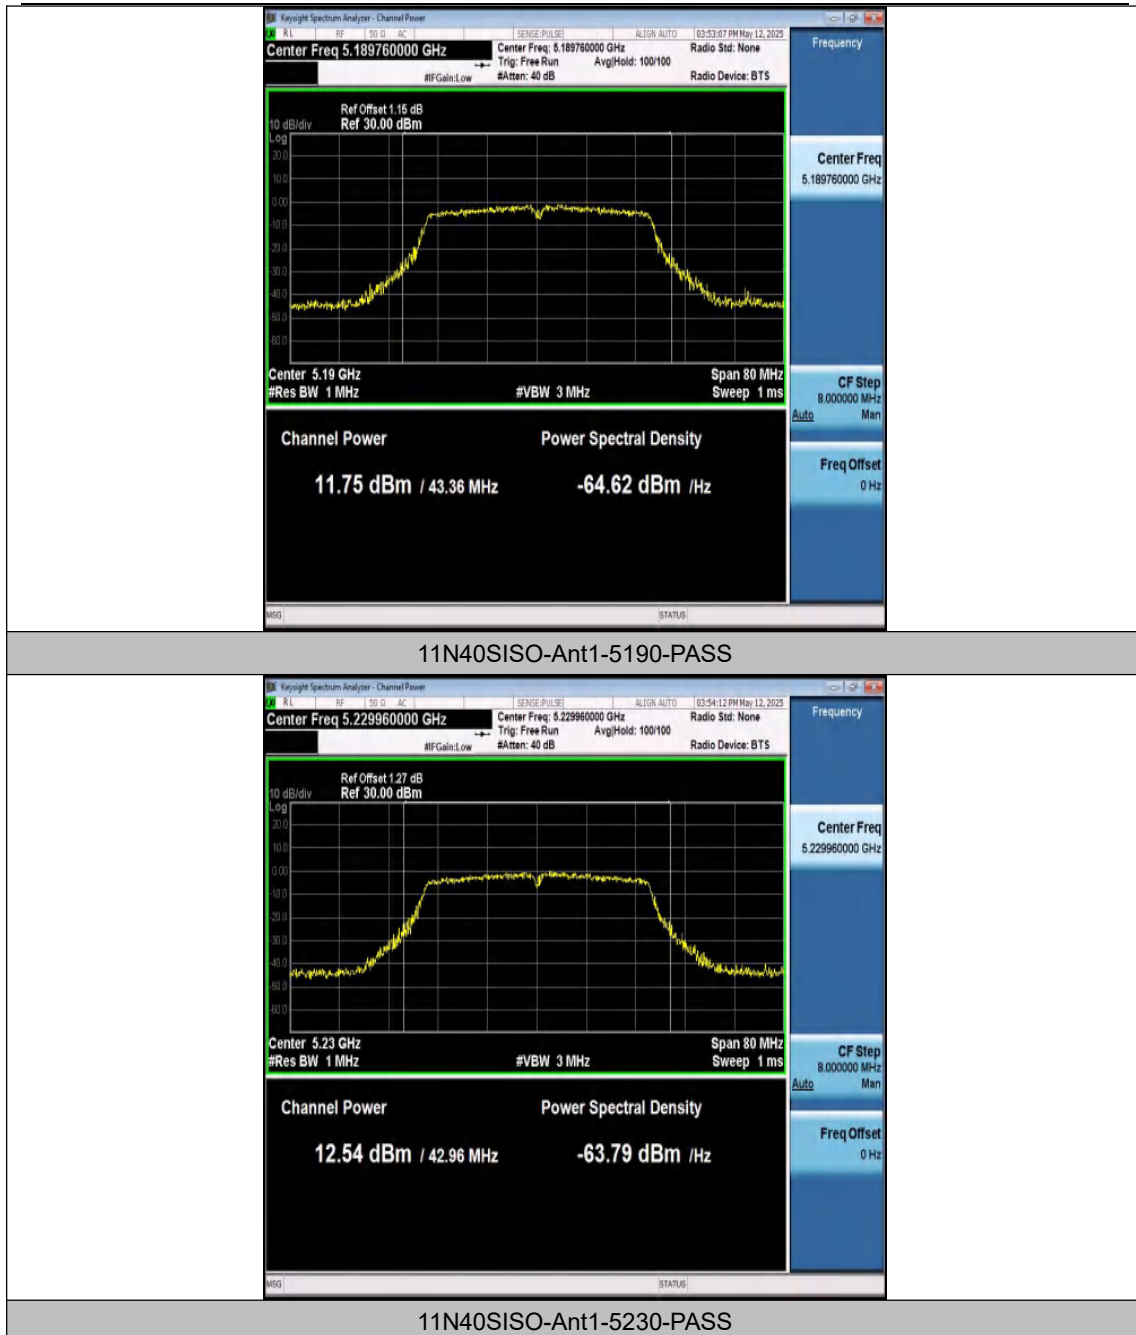


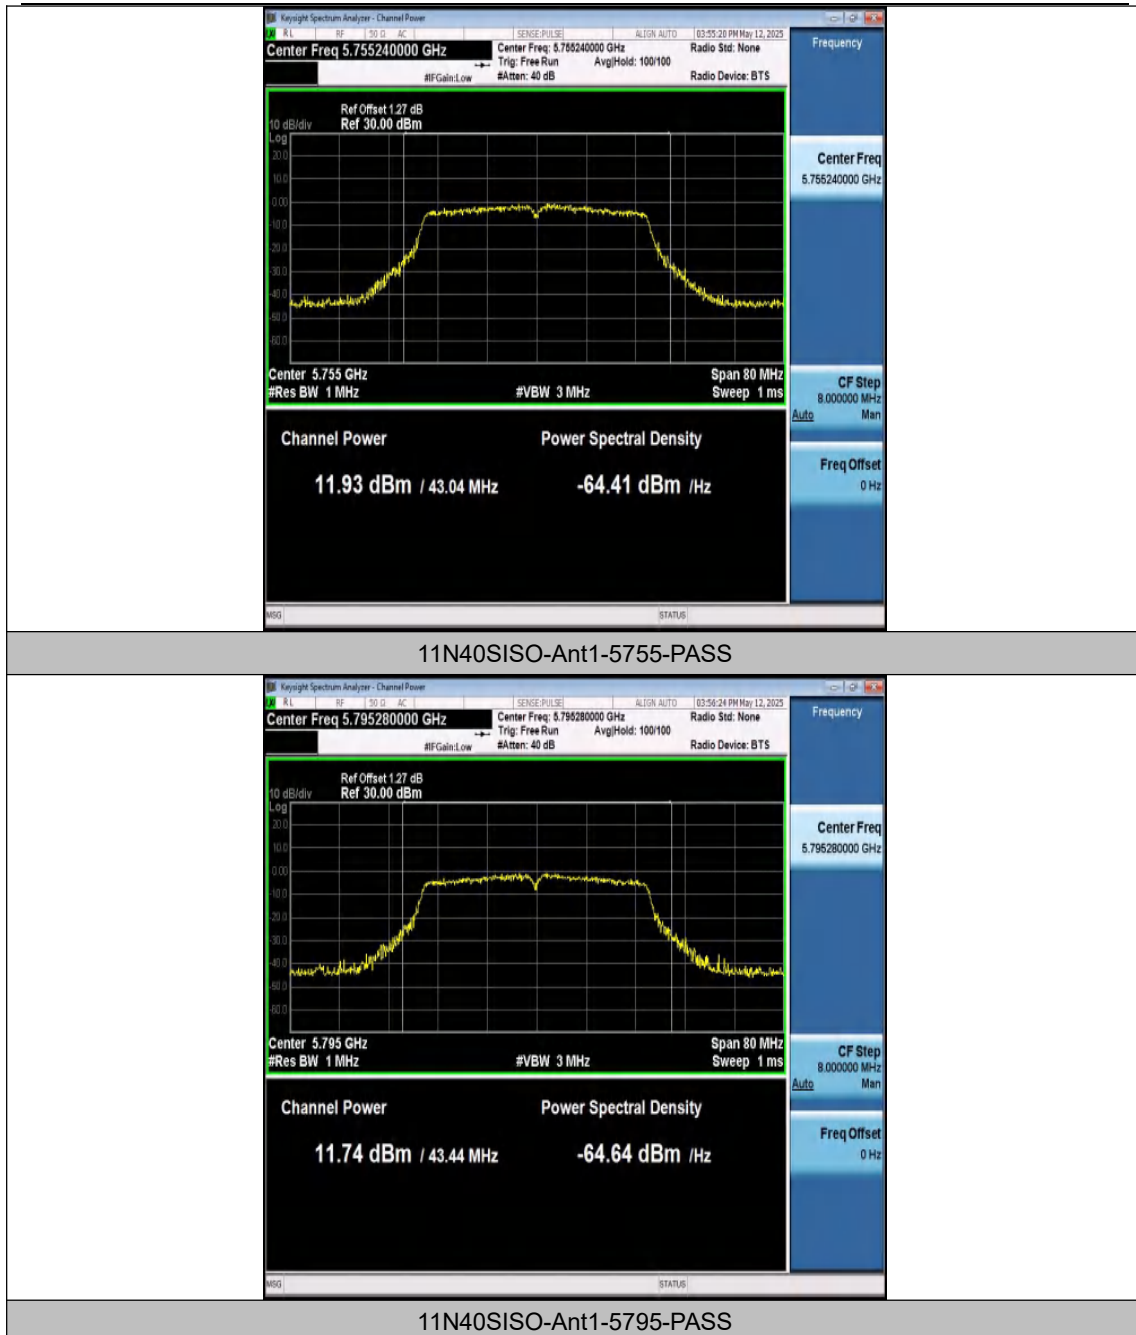


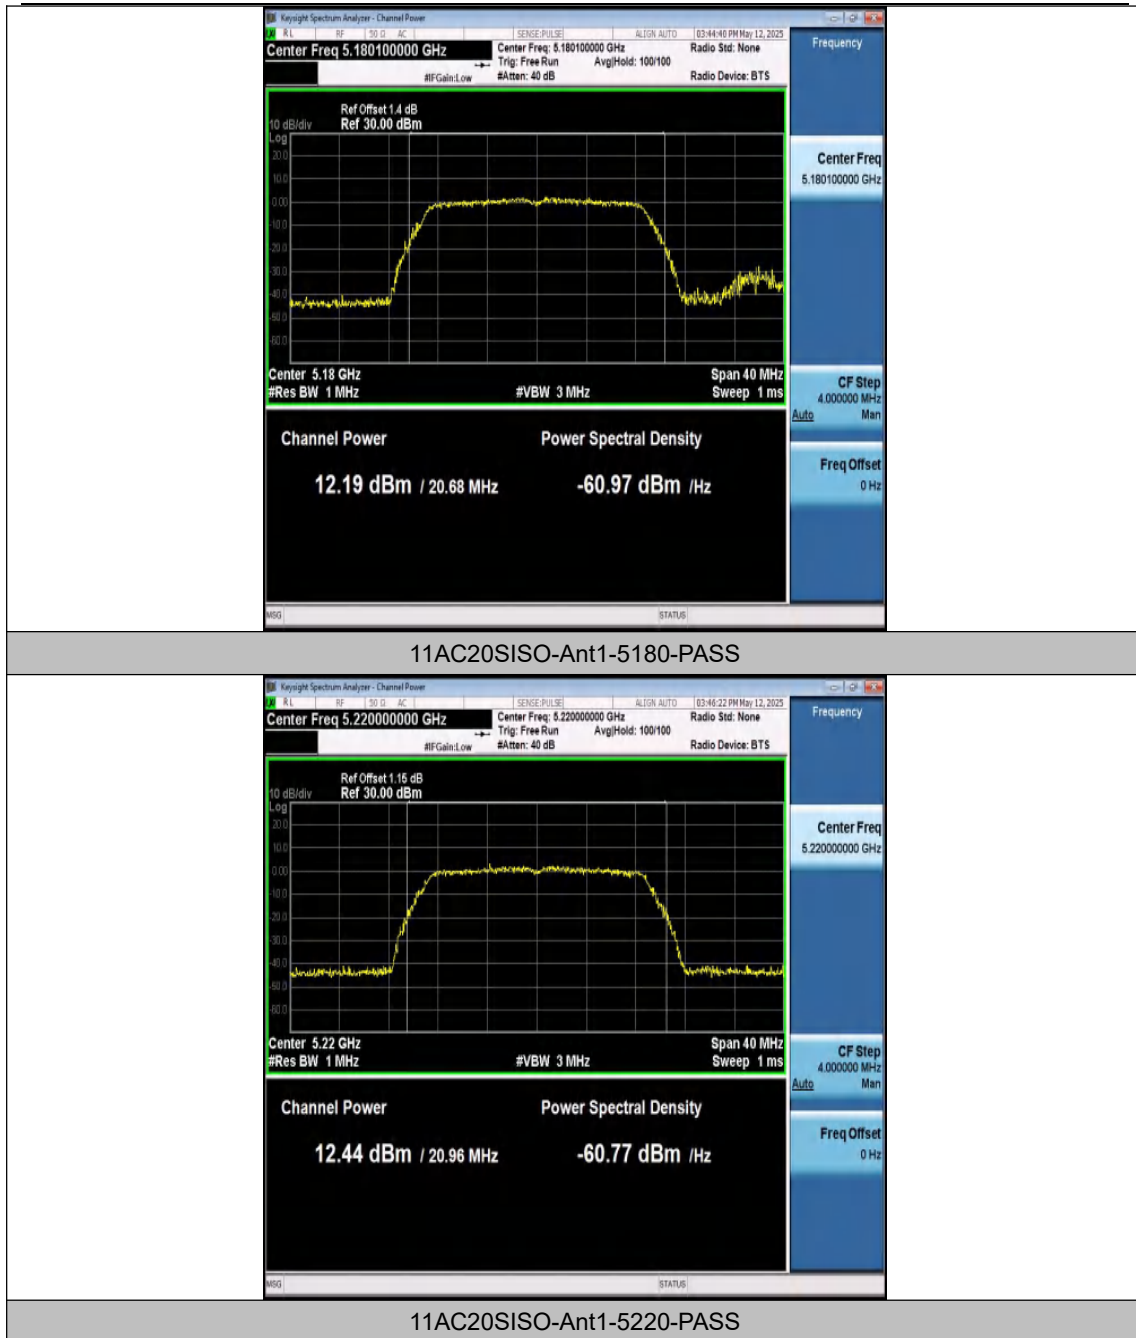


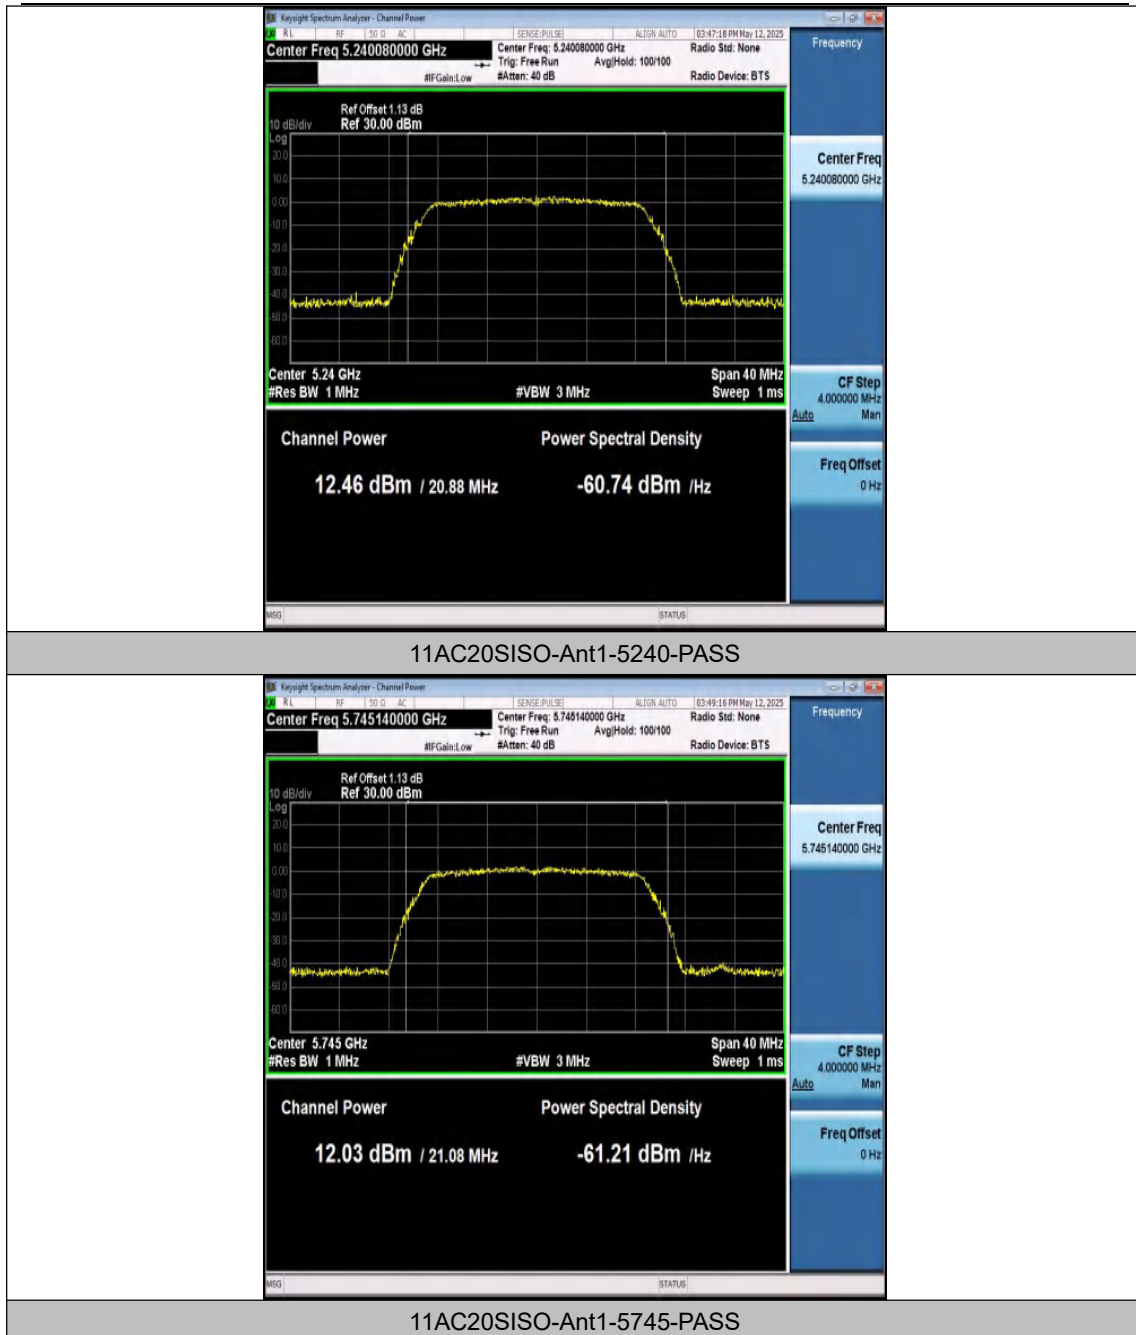

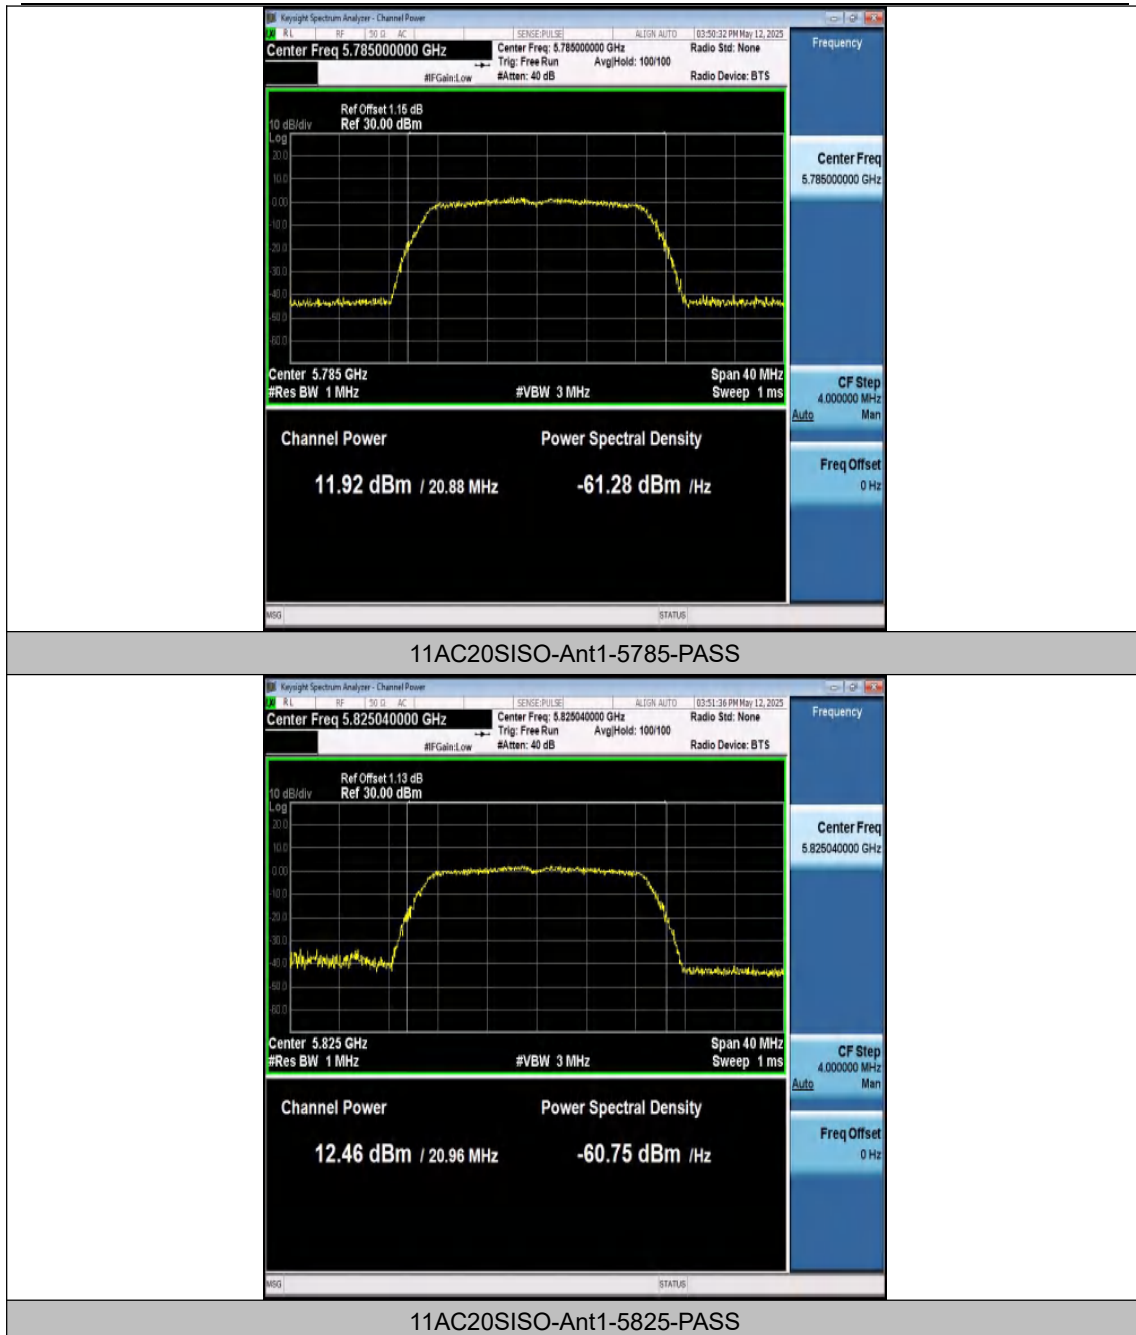

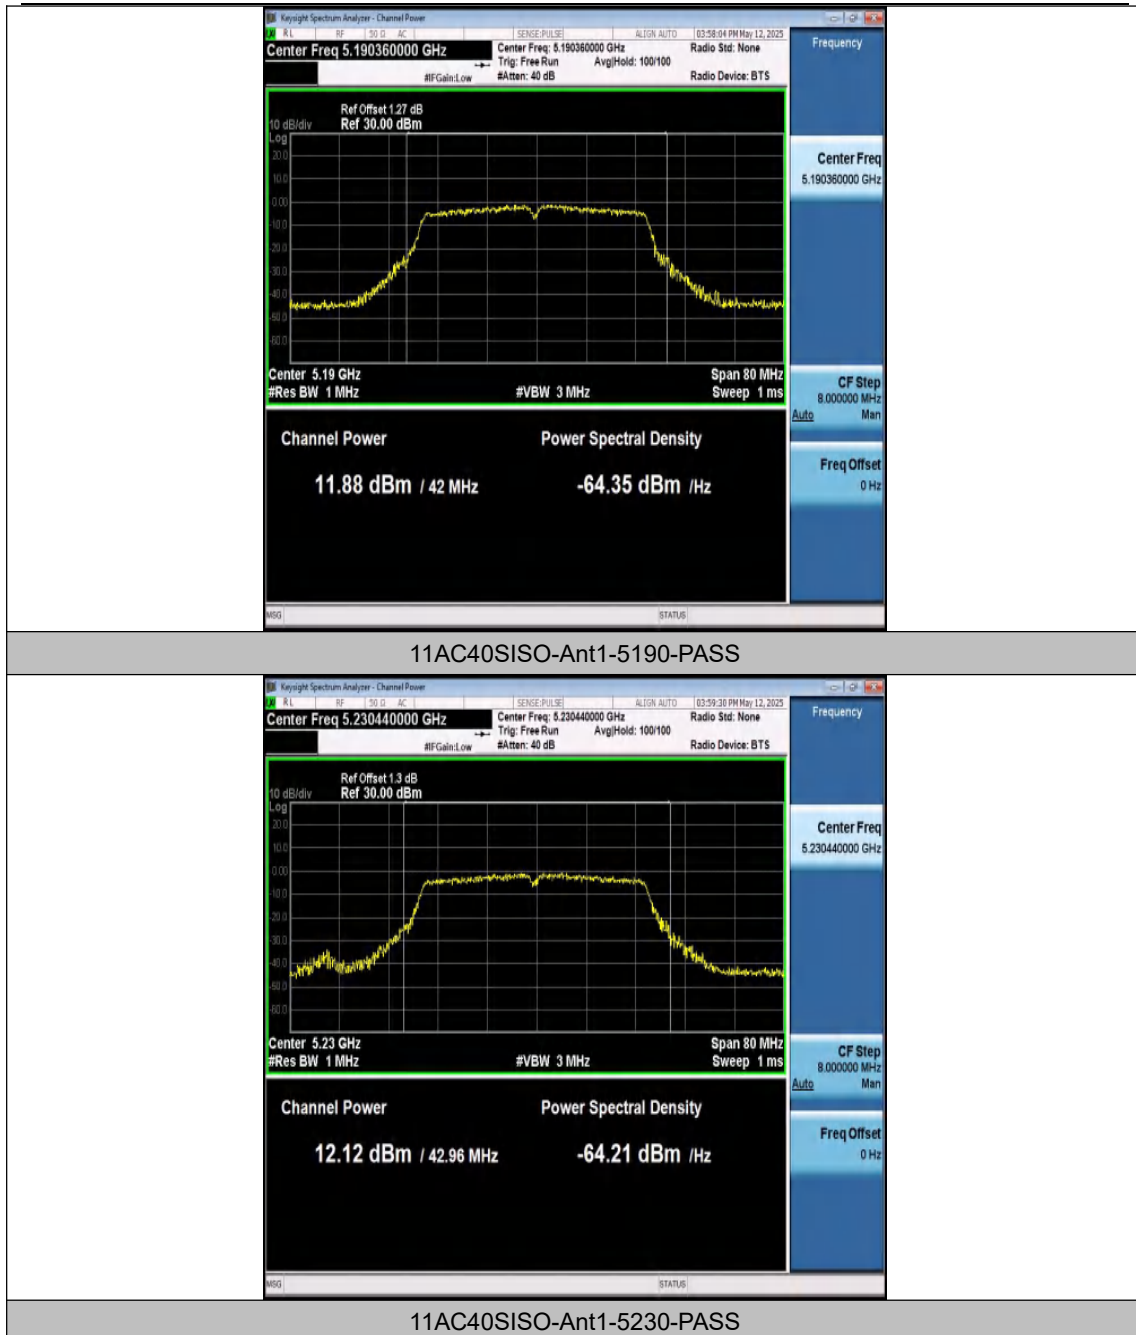

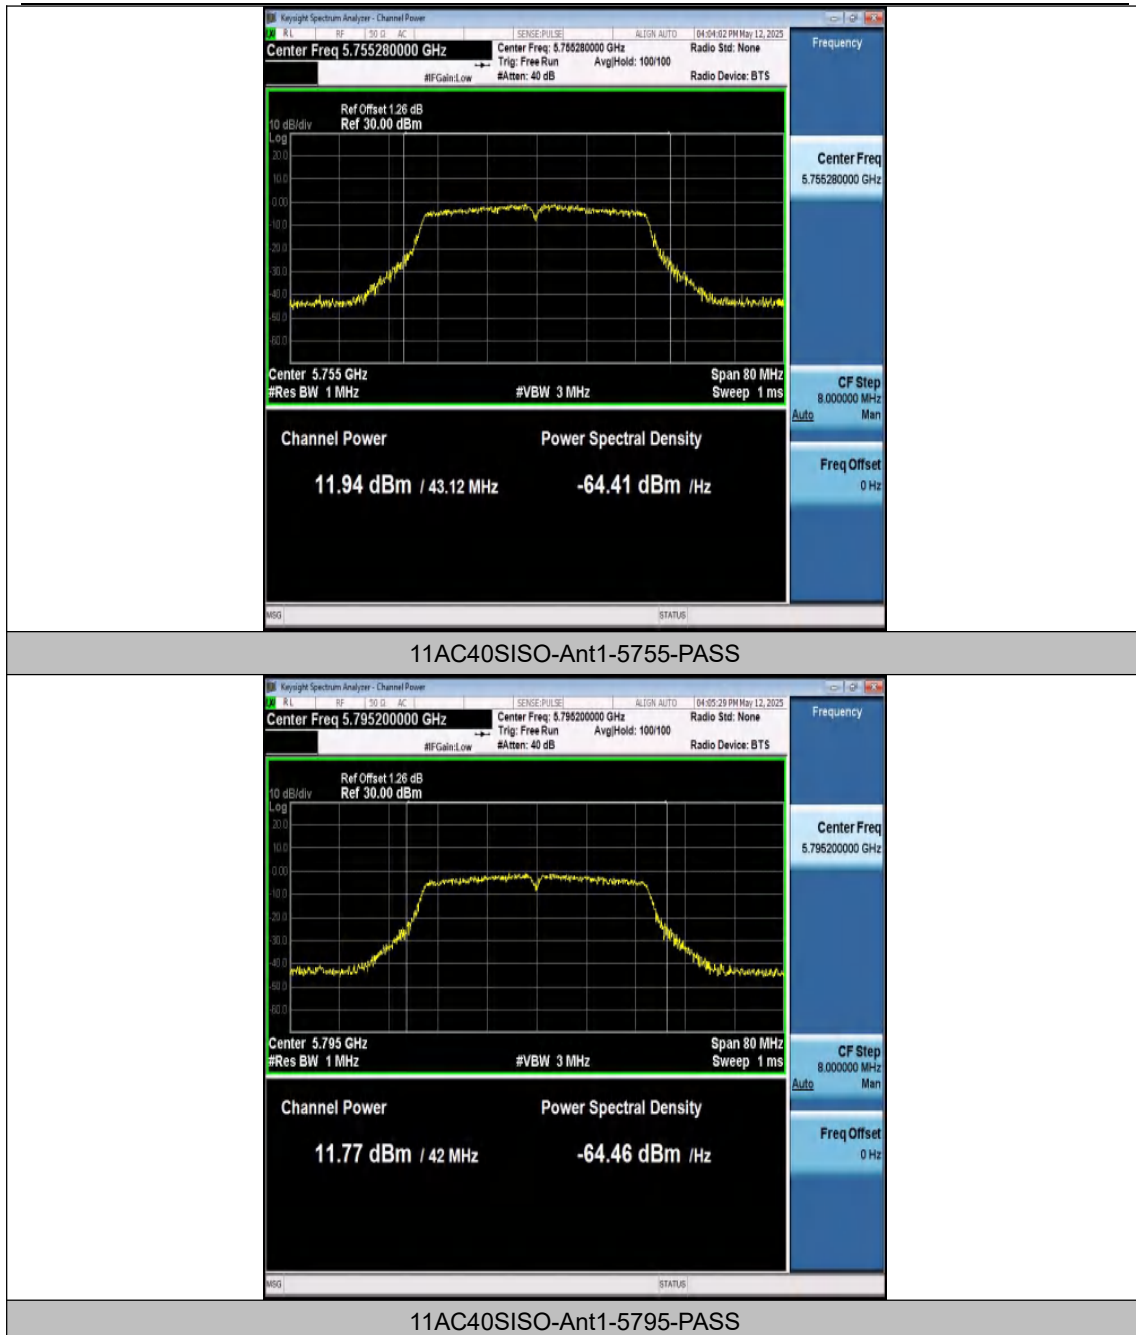

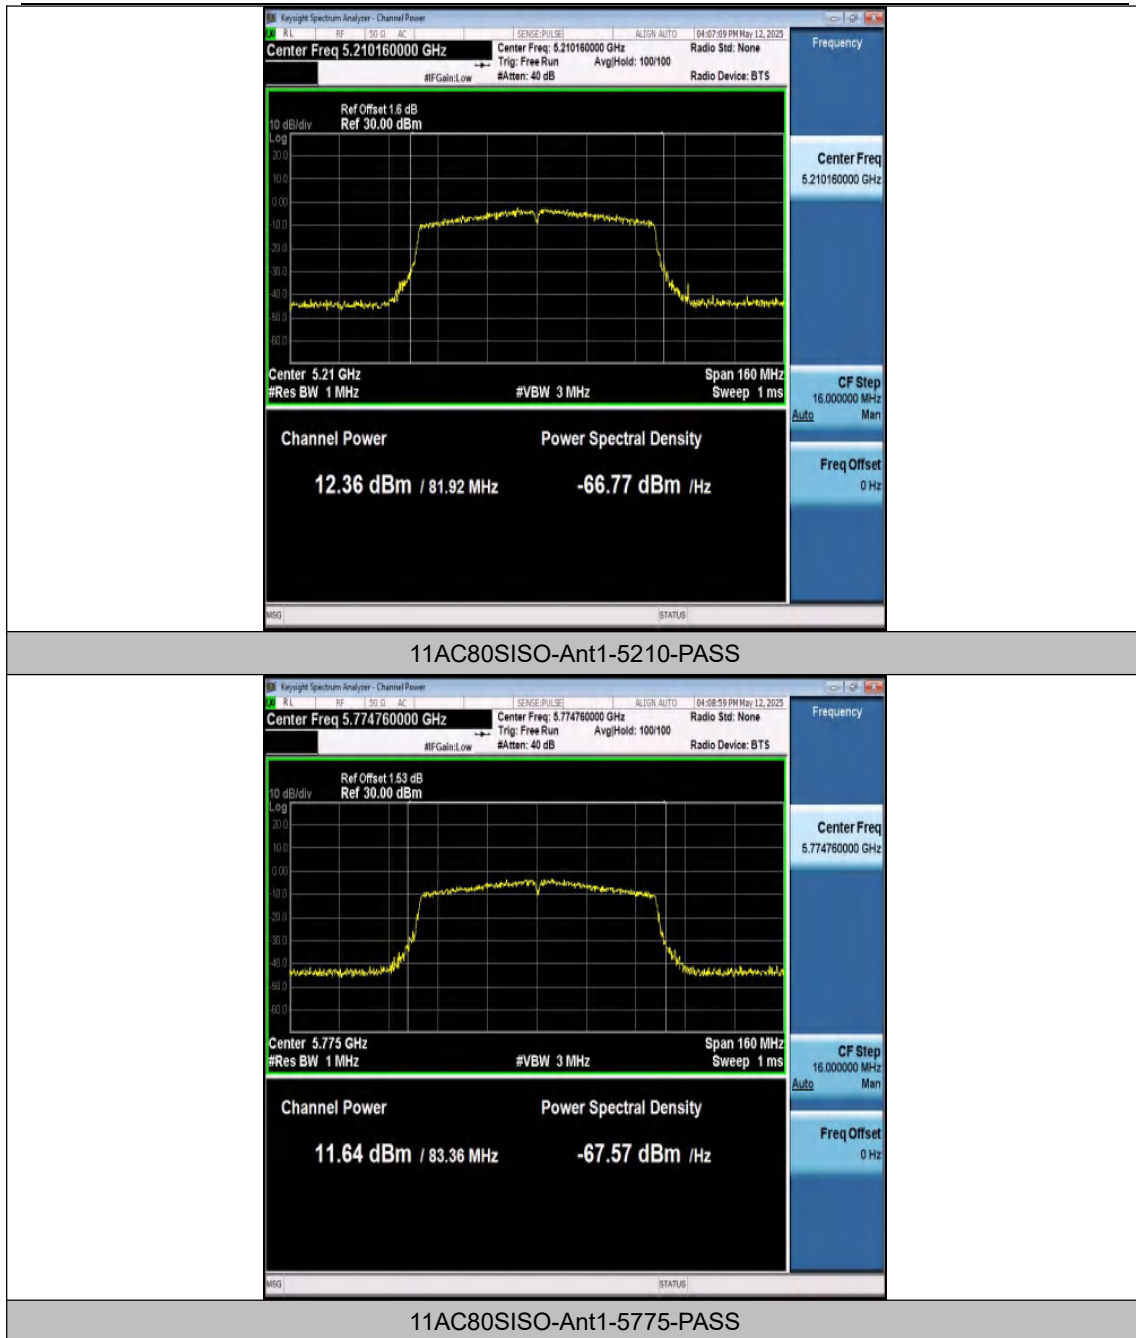

Appendix D: Maximum Power Spectral Density

Test Result B1

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm /MHz]	DC Factor [dBm]	Result [dBm]	Limit [dBm/MHz]	Verdict
11A	Ant1	5180	-3.76	0.12	-3.64	≤10.00	PASS
11A	Ant1	5220	-2.74	0.12	-2.62	≤10.00	PASS
11A	Ant1	5240	-2.64	0.12	-2.52	≤10.00	PASS
11N20SI SO	Ant1	5180	-3.82	0.13	-3.69	≤10.00	PASS
11N20SI SO	Ant1	5220	-2.73	0.13	-2.60	≤10.00	PASS
11N20SI SO	Ant1	5240	-2.89	0.13	-2.76	≤10.00	PASS
11N40SI SO	Ant1	5190	-6.75	0.15	-6.60	≤10.00	PASS
11N40SI SO	Ant1	5230	-6.08	0.27	-5.81	≤10.00	PASS
11AC20S ISO	Ant1	5180	-3.11	0.40	-2.71	≤10.00	PASS
11AC20S ISO	Ant1	5220	-3.02	0.15	-2.87	≤10.00	PASS
11AC20S ISO	Ant1	5240	-3.05	0.13	-2.92	≤10.00	PASS
11AC40S ISO	Ant1	5190	-6.60	0.27	-6.33	≤10.00	PASS
11AC40S ISO	Ant1	5230	-6.63	0.30	-6.33	≤10.00	PASS
11AC80S ISO	Ant1	5210	-9.21	0.60	-8.61	≤10.00	PASS


Note: 1.The Duty Cycle Factor and cable loss are compensated in the graph.

Test Result B4

Test Mode	Antenna	Frequency[MHz]	Reading Result[dBm /510KHz]	DC Factor [dBm]	Result [dBm/500KHz]	Limit [dBm/500KHz]	Verdict
11A	Ant1	5745	-5.66	0.14	-5.61	≤30.00	PASS
11A	Ant1	5785	-6.09	0.12	-6.06	≤30.00	PASS
11A	Ant1	5825	-5.98	0.12	-5.95	≤30.00	PASS
11N20SI SO	Ant1	5745	-6.28	0.13	-6.24	≤30.00	PASS
11N20SI SO	Ant1	5785	-6.35	0.13	-6.31	≤30.00	PASS
11N20SI SO	Ant1	5825	-6.30	0.13	-6.26	≤30.00	PASS
11N40SI SO	Ant1	5755	-9.25	0.27	-9.07	≤30.00	PASS
11N40SI SO	Ant1	5795	-9.63	0.27	-9.45	≤30.00	PASS
11AC20S ISO	Ant1	5745	-6.32	0.13	-6.28	≤30.00	PASS
11AC20S ISO	Ant1	5785	-6.61	0.15	-6.55	≤30.00	PASS
11AC20S ISO	Ant1	5825	-6.01	0.13	-5.97	≤30.00	PASS
11AC40S ISO	Ant1	5755	-9.26	0.26	-9.09	≤30.00	PASS
11AC40S ISO	Ant1	5795	-9.55	0.26	-9.38	≤30.00	PASS
11AC80S ISO	Ant1	5775	-12.69	0.53	-12.25	≤30.00	PASS

Note: 1.The Duty Cycle Factor and cable loss and RBW Factor are compensated in the graph.


Test Graphs

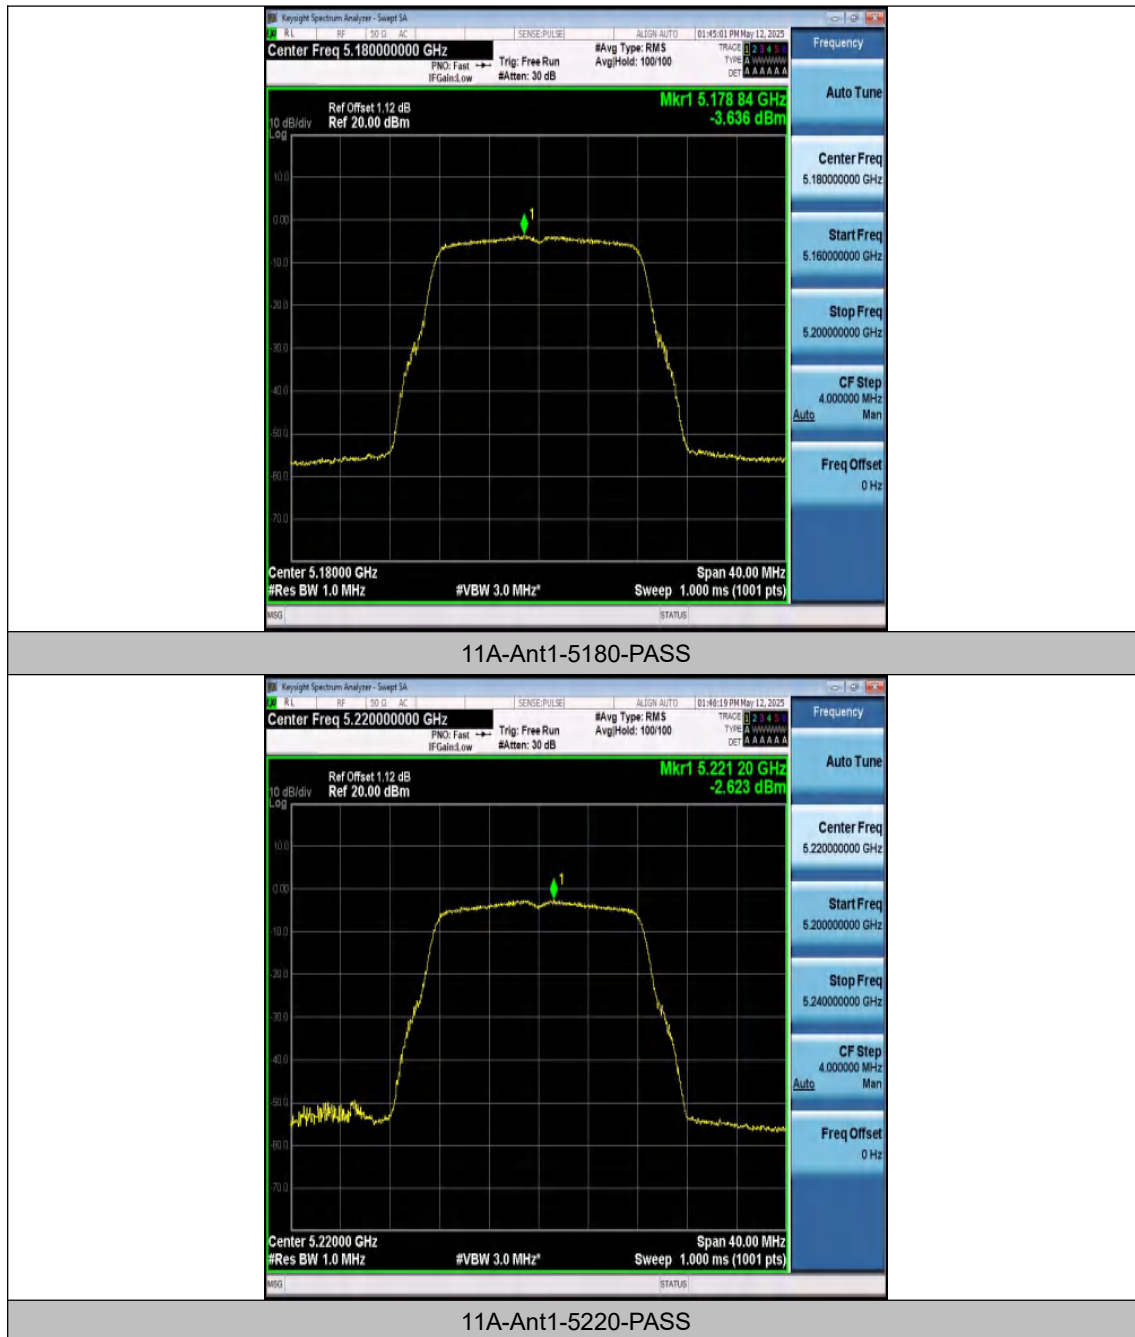

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

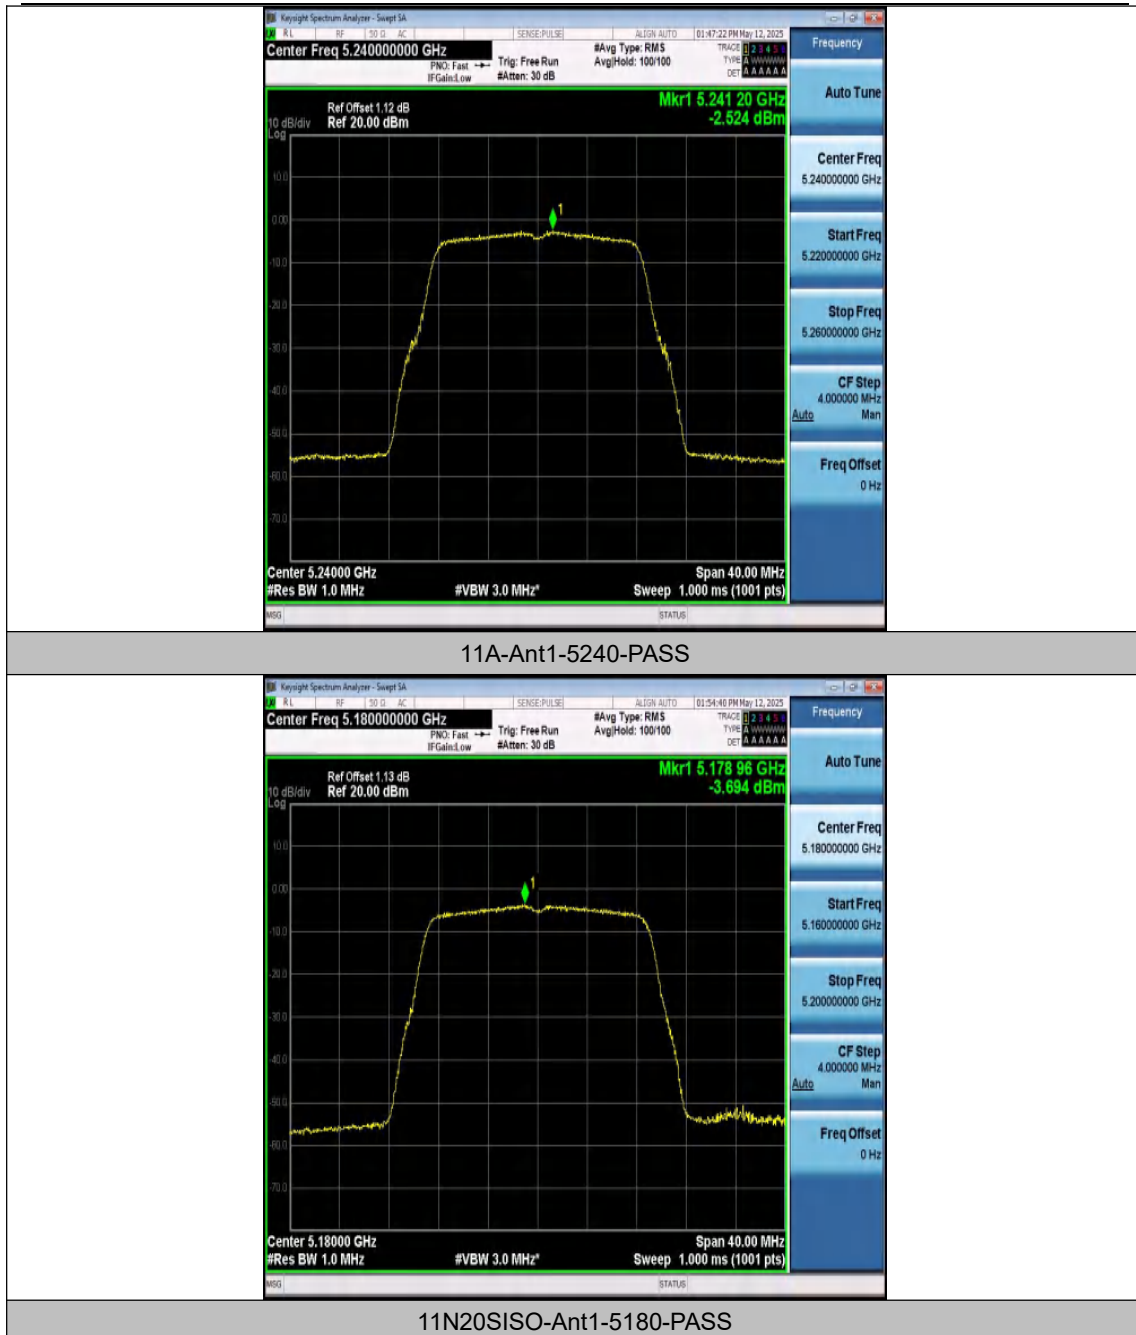

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

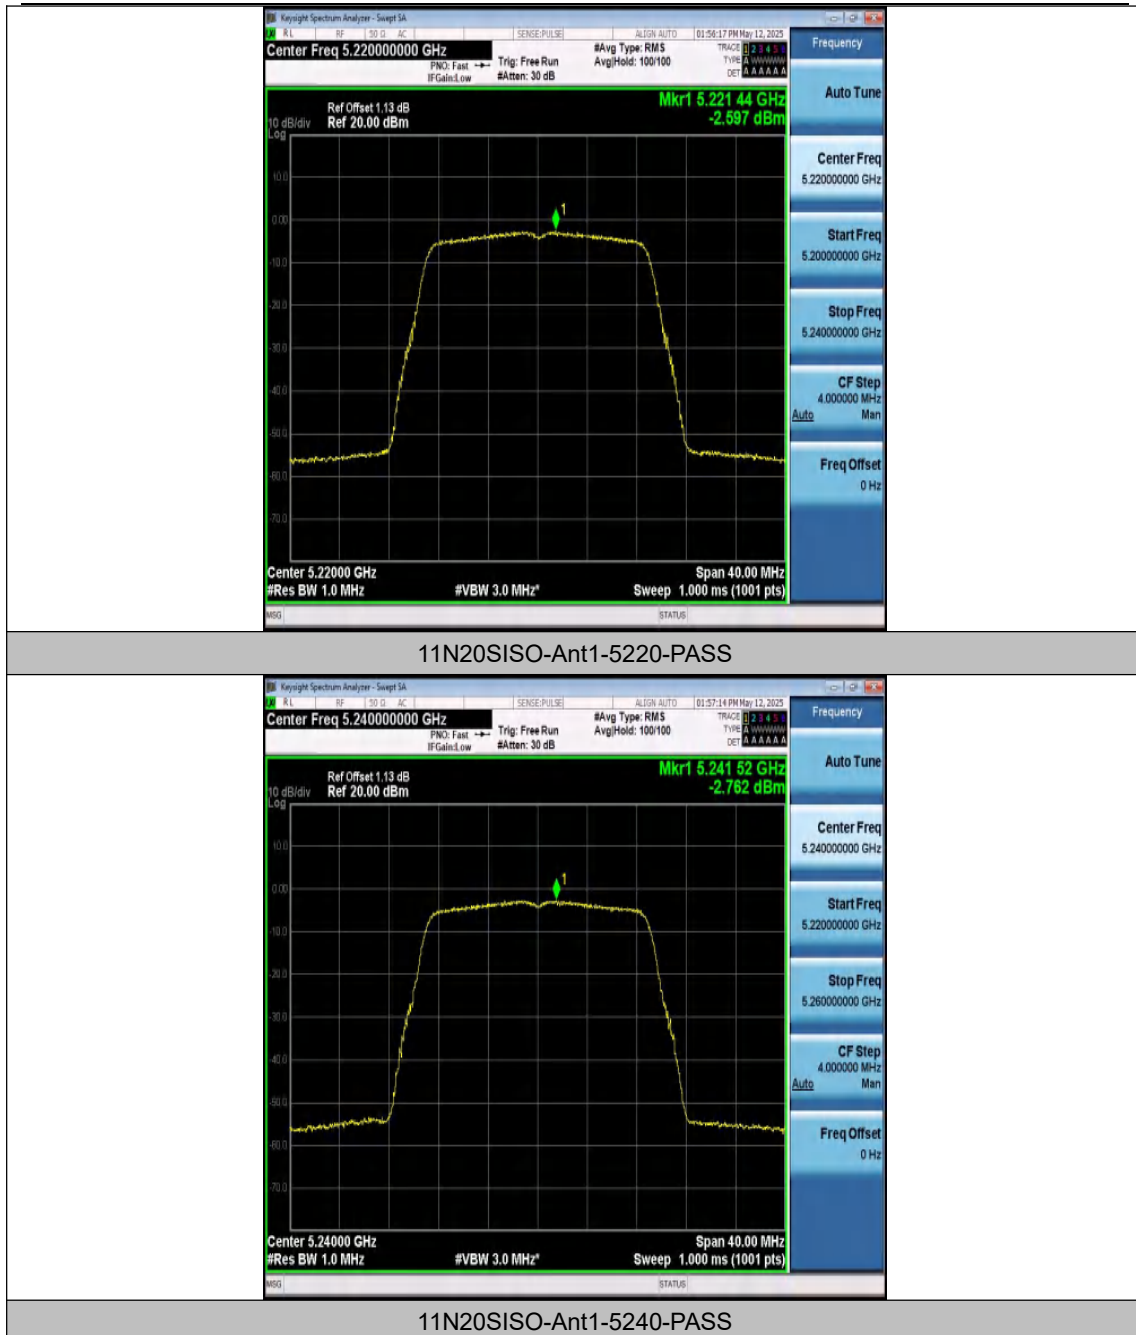

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

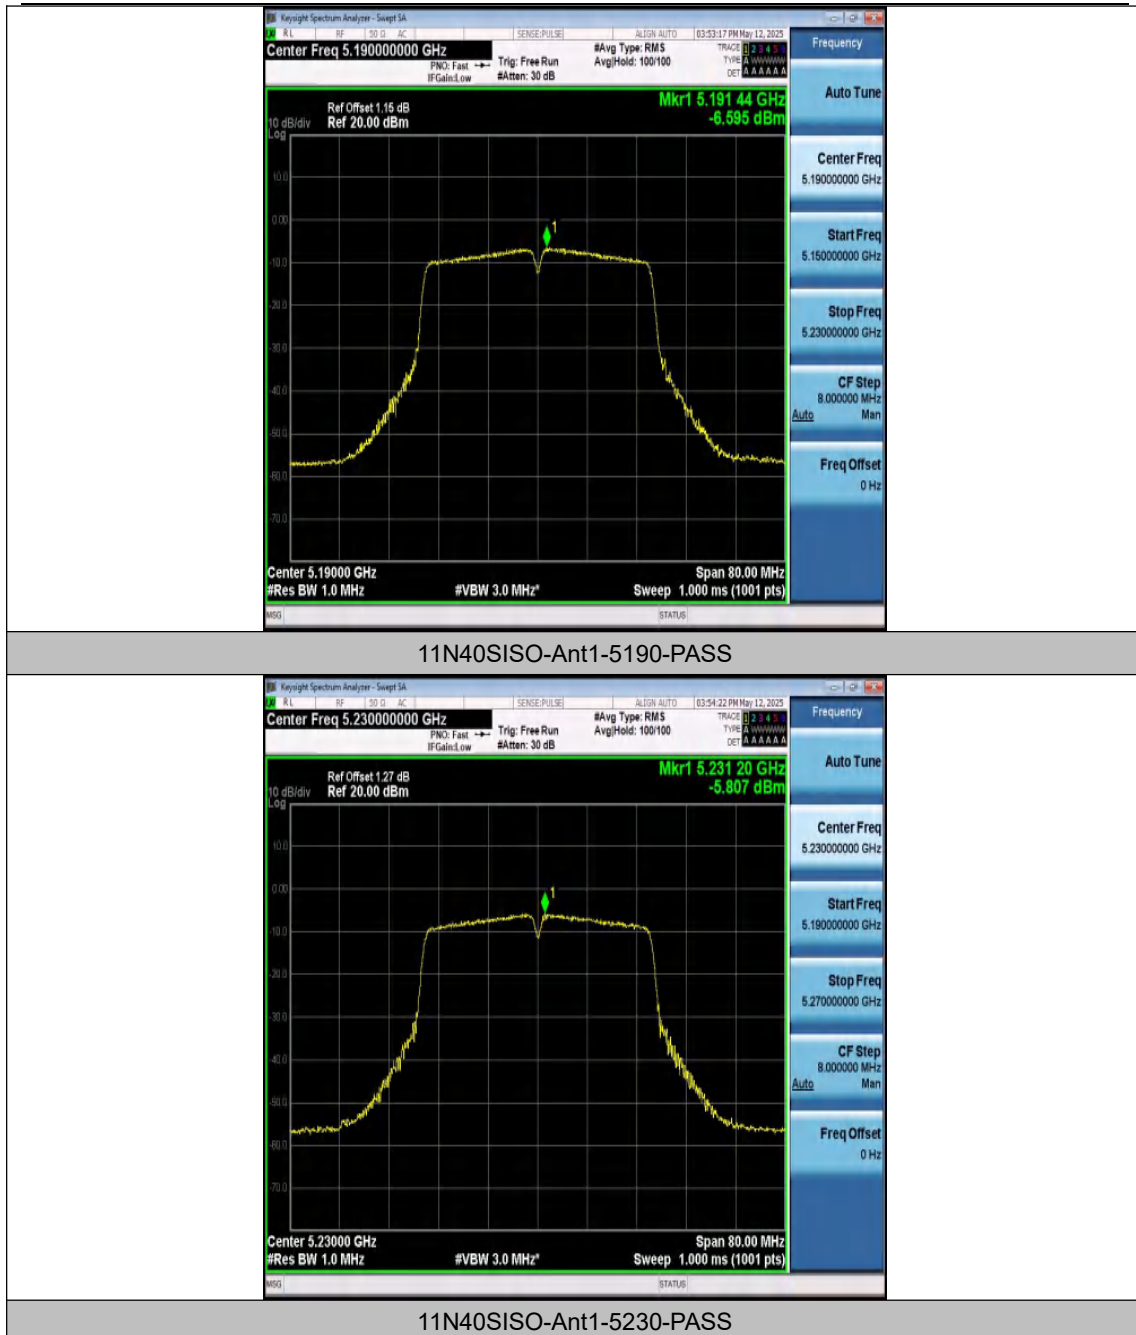

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

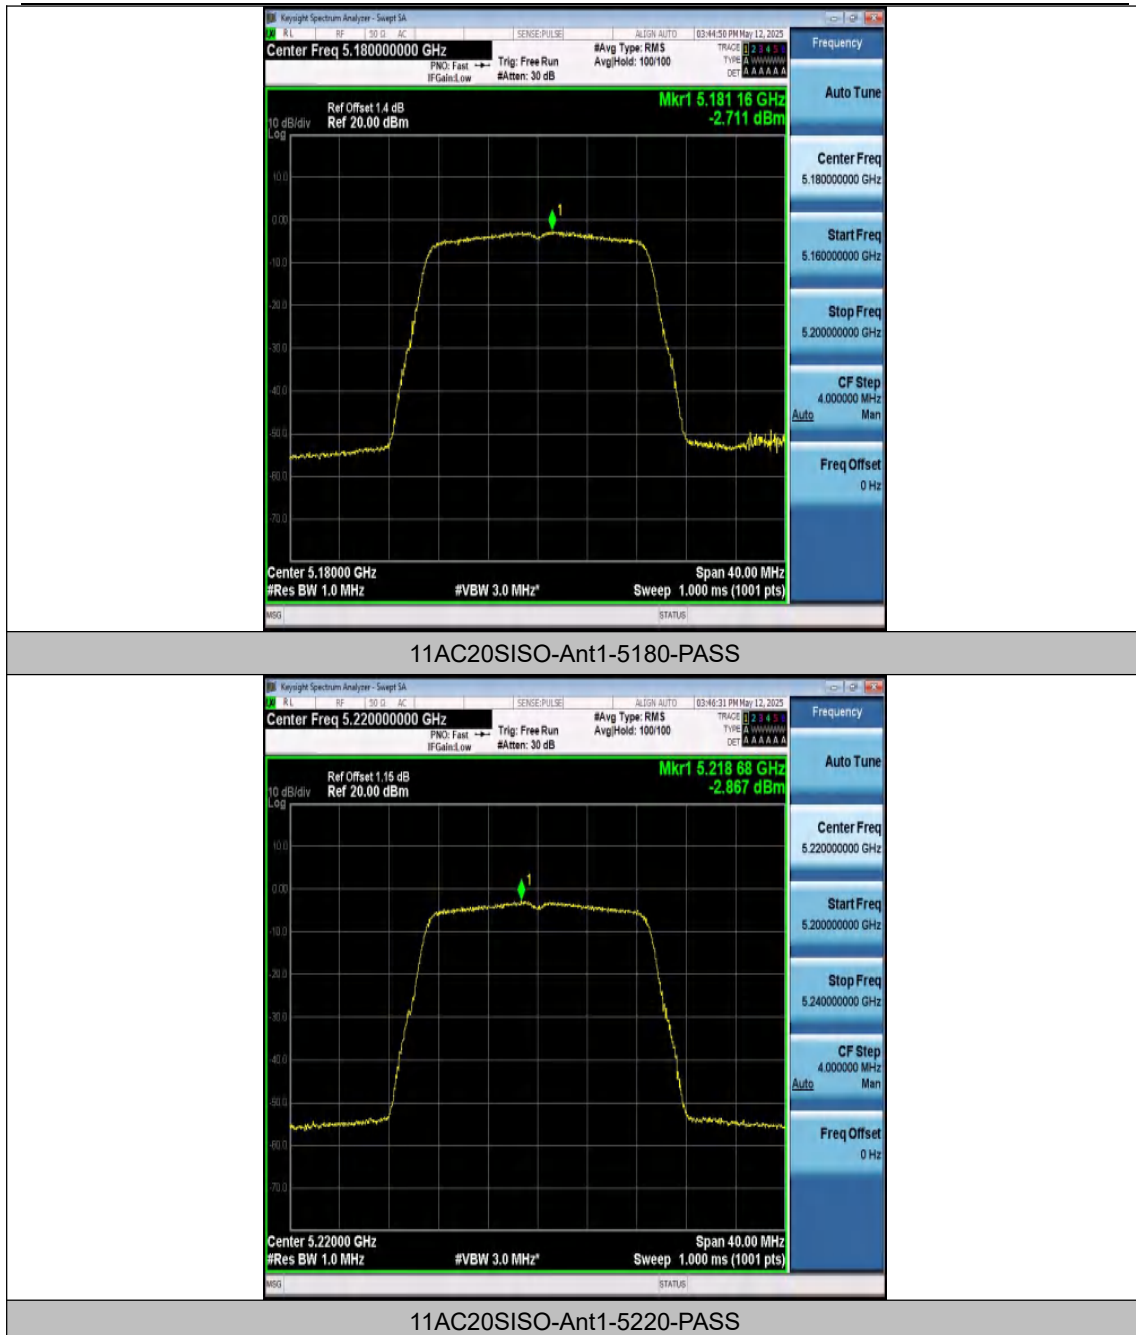

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

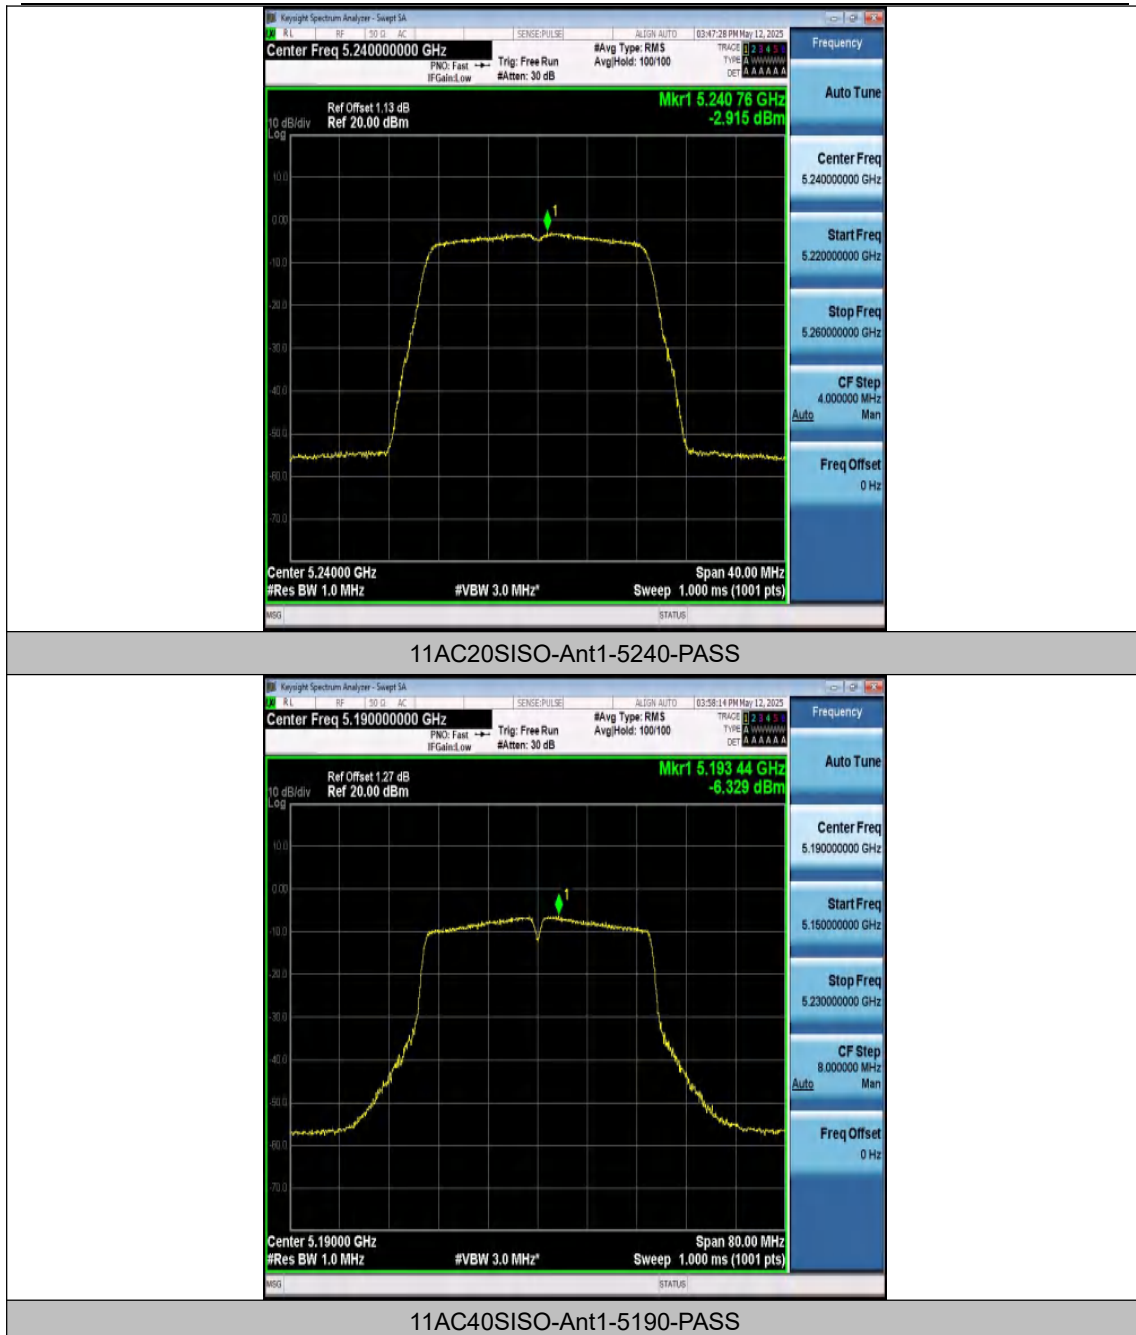


Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

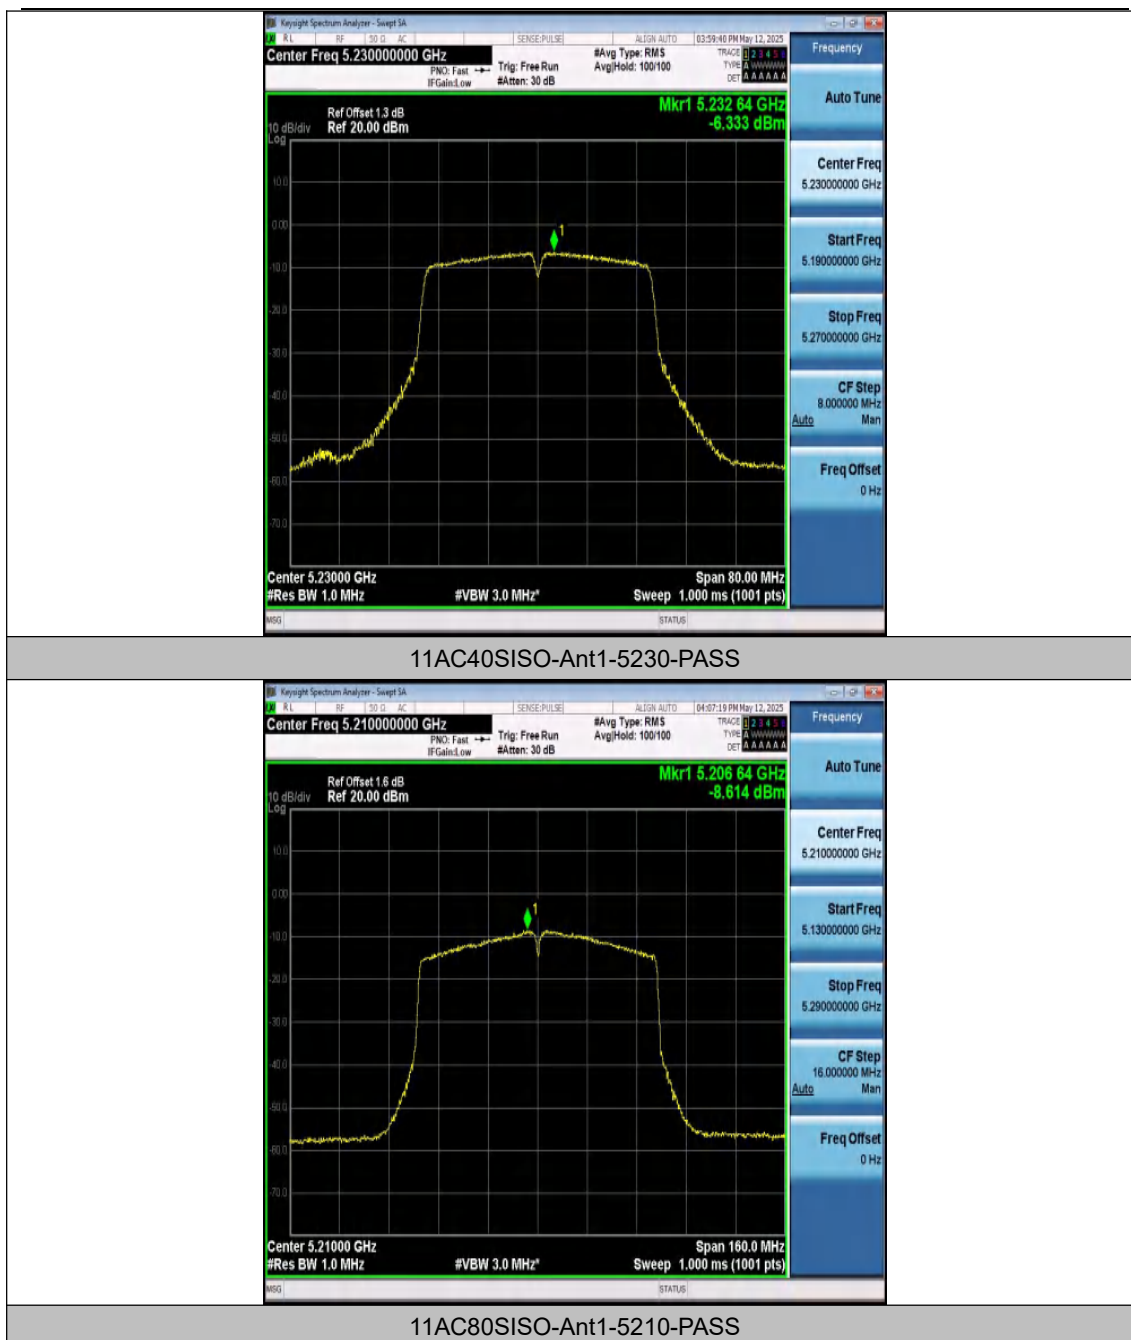

Test Graphs B4

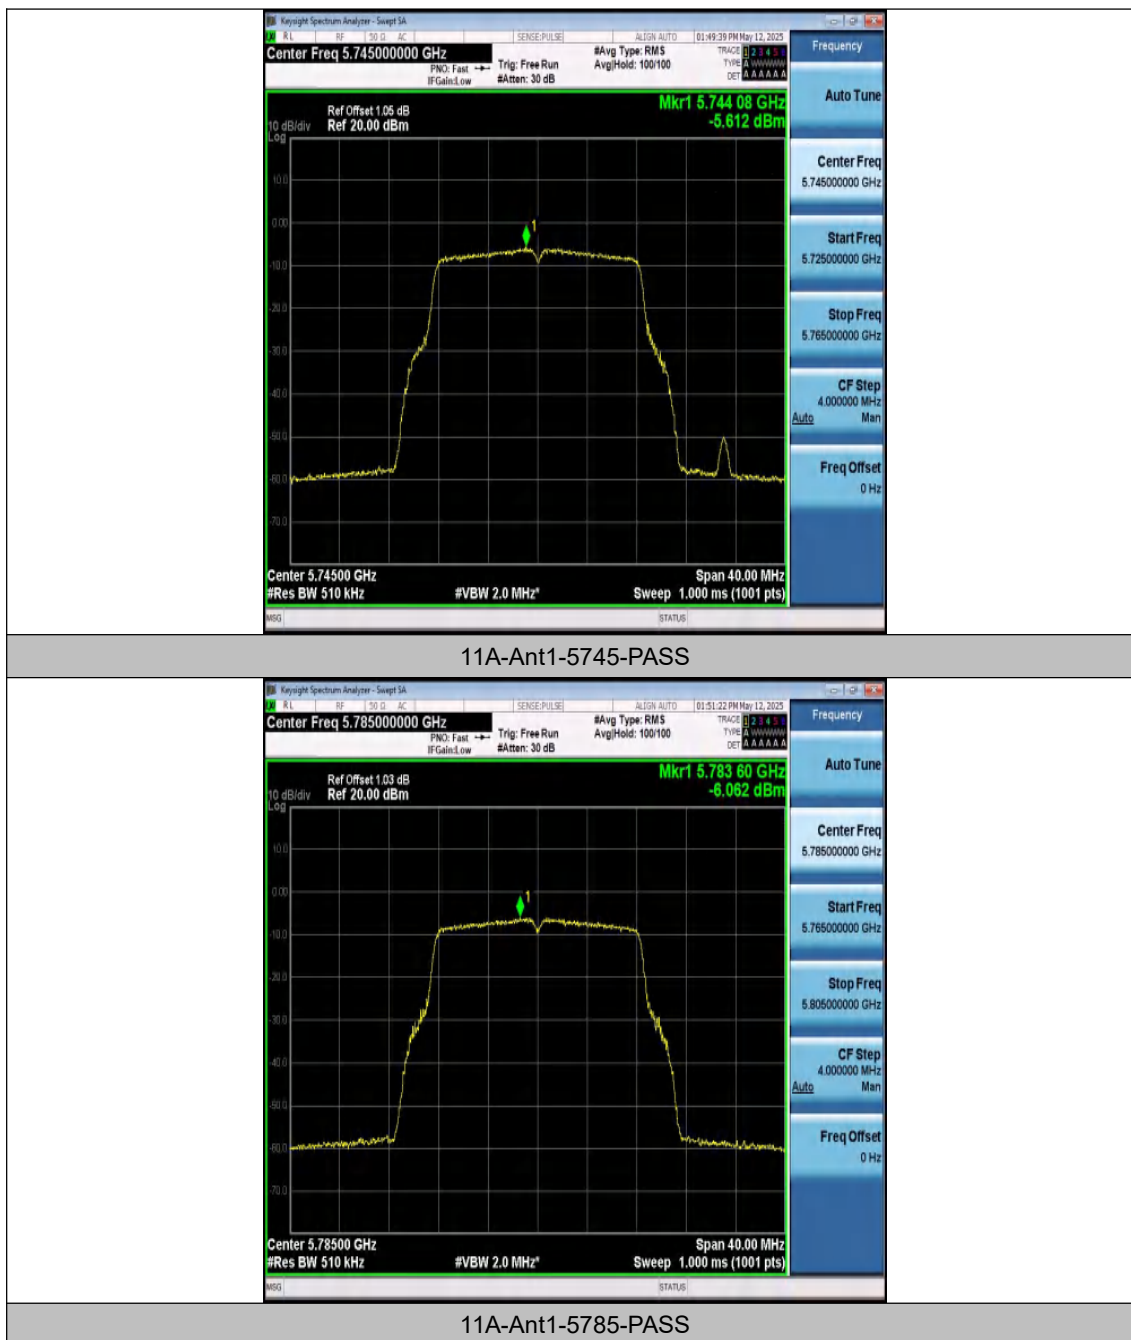

Shenzhen Anbotek Compliance Laboratory Limited


Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China


Tel: (86) 0755-26066440 Email: service@anbotek.com



Hotline
400-003-0500

www.anbotek.com

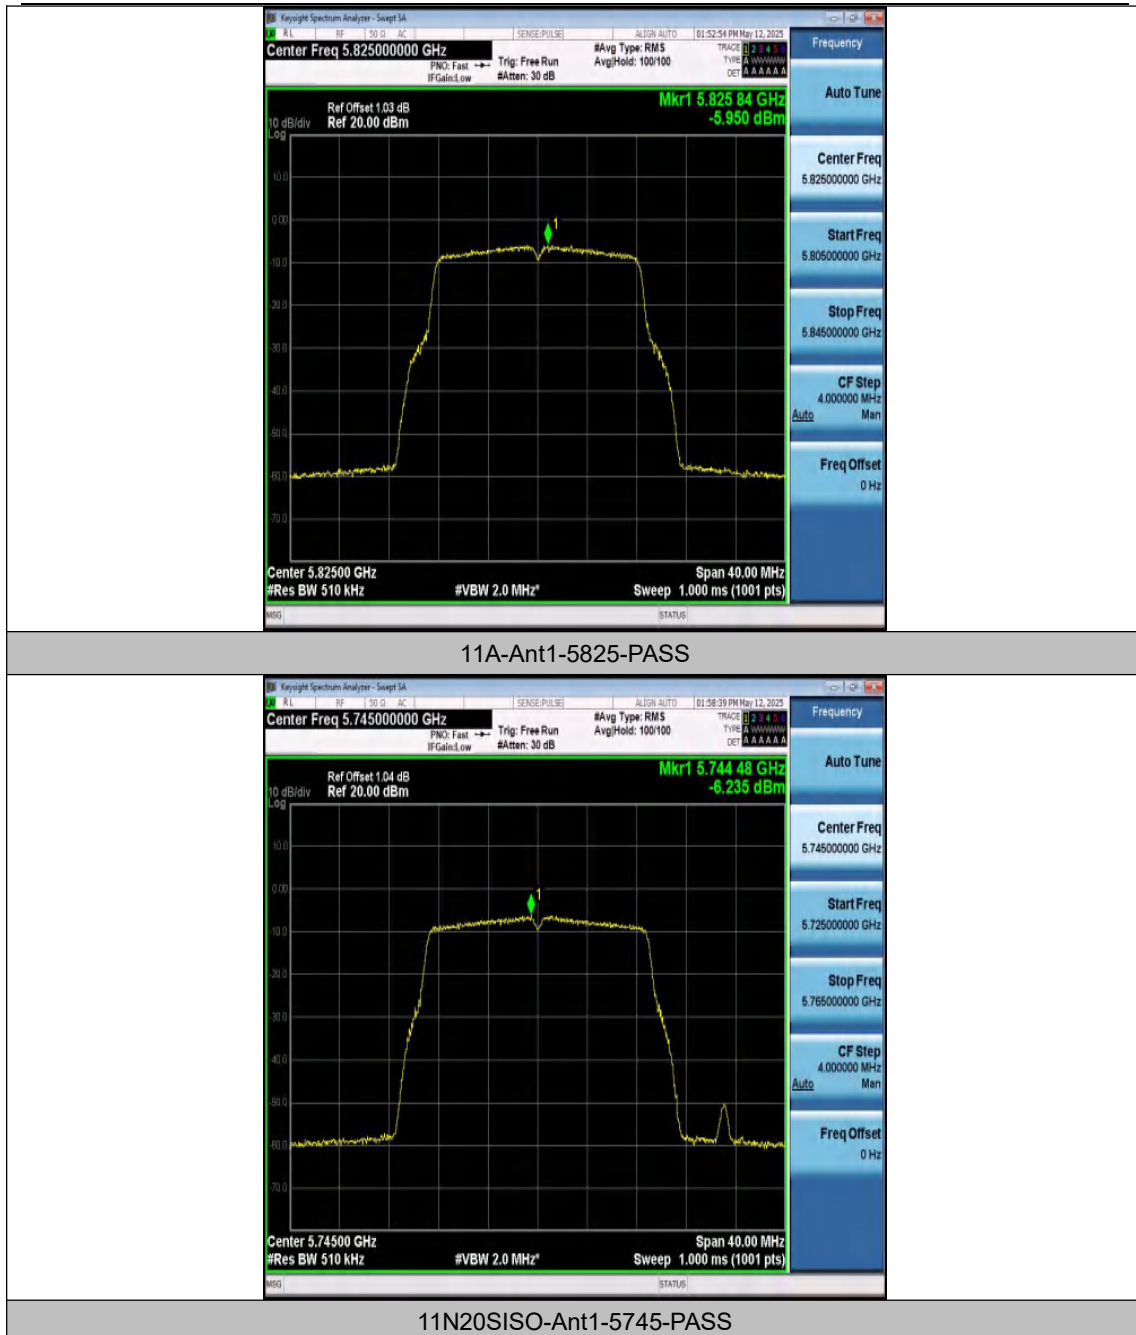


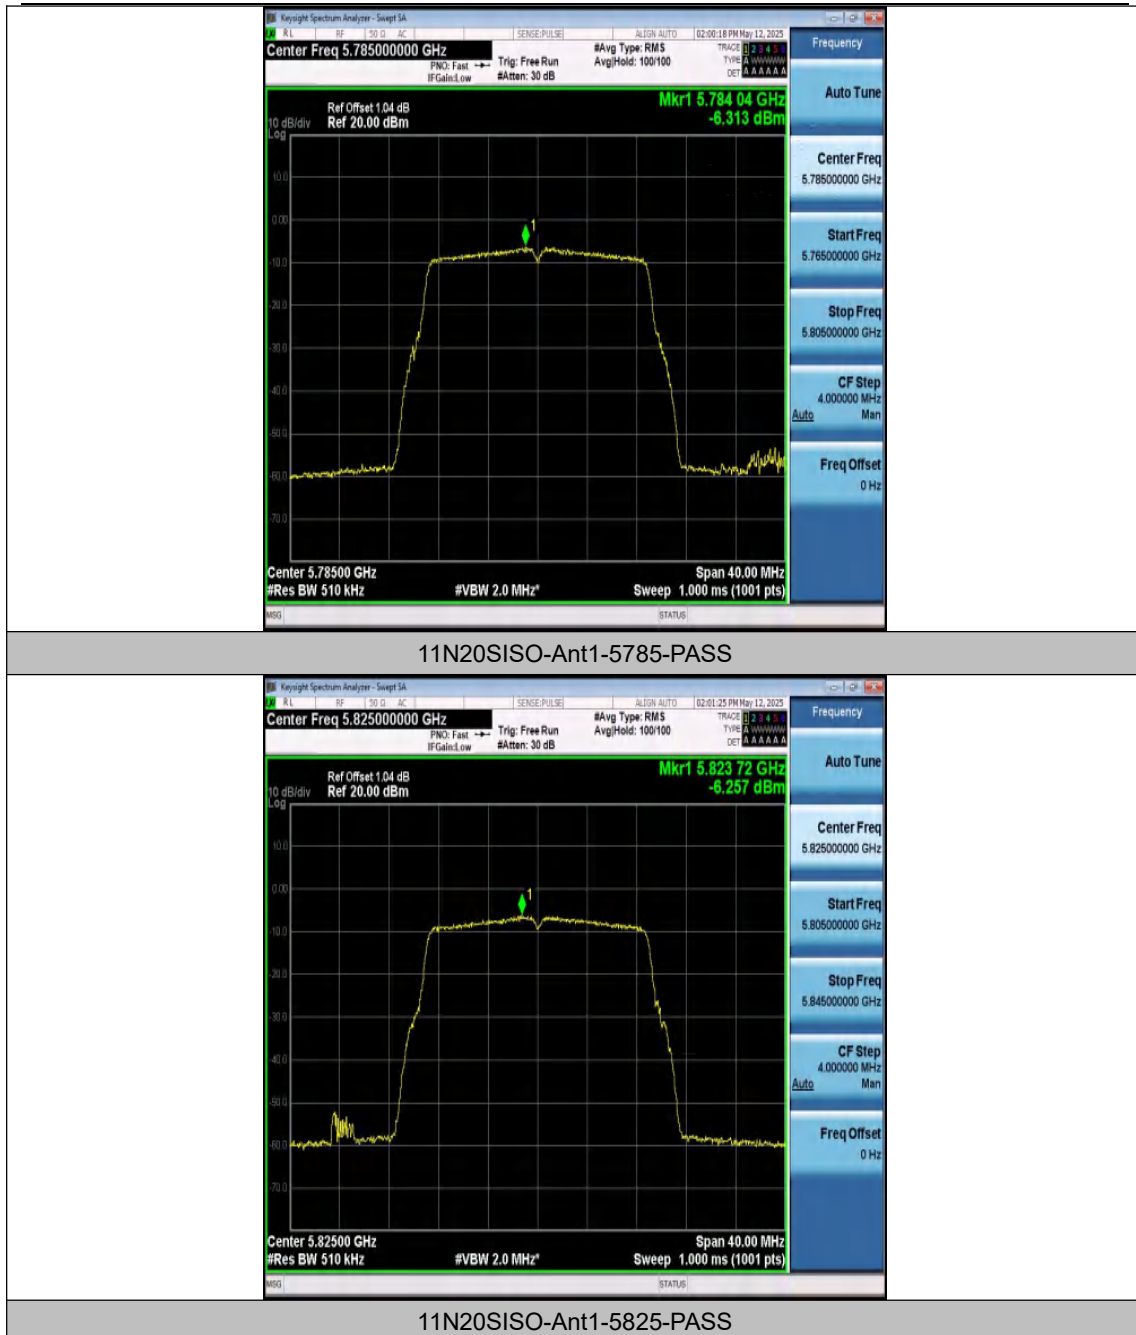

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com


Hotline
400-003-0500
www.anbotech.com

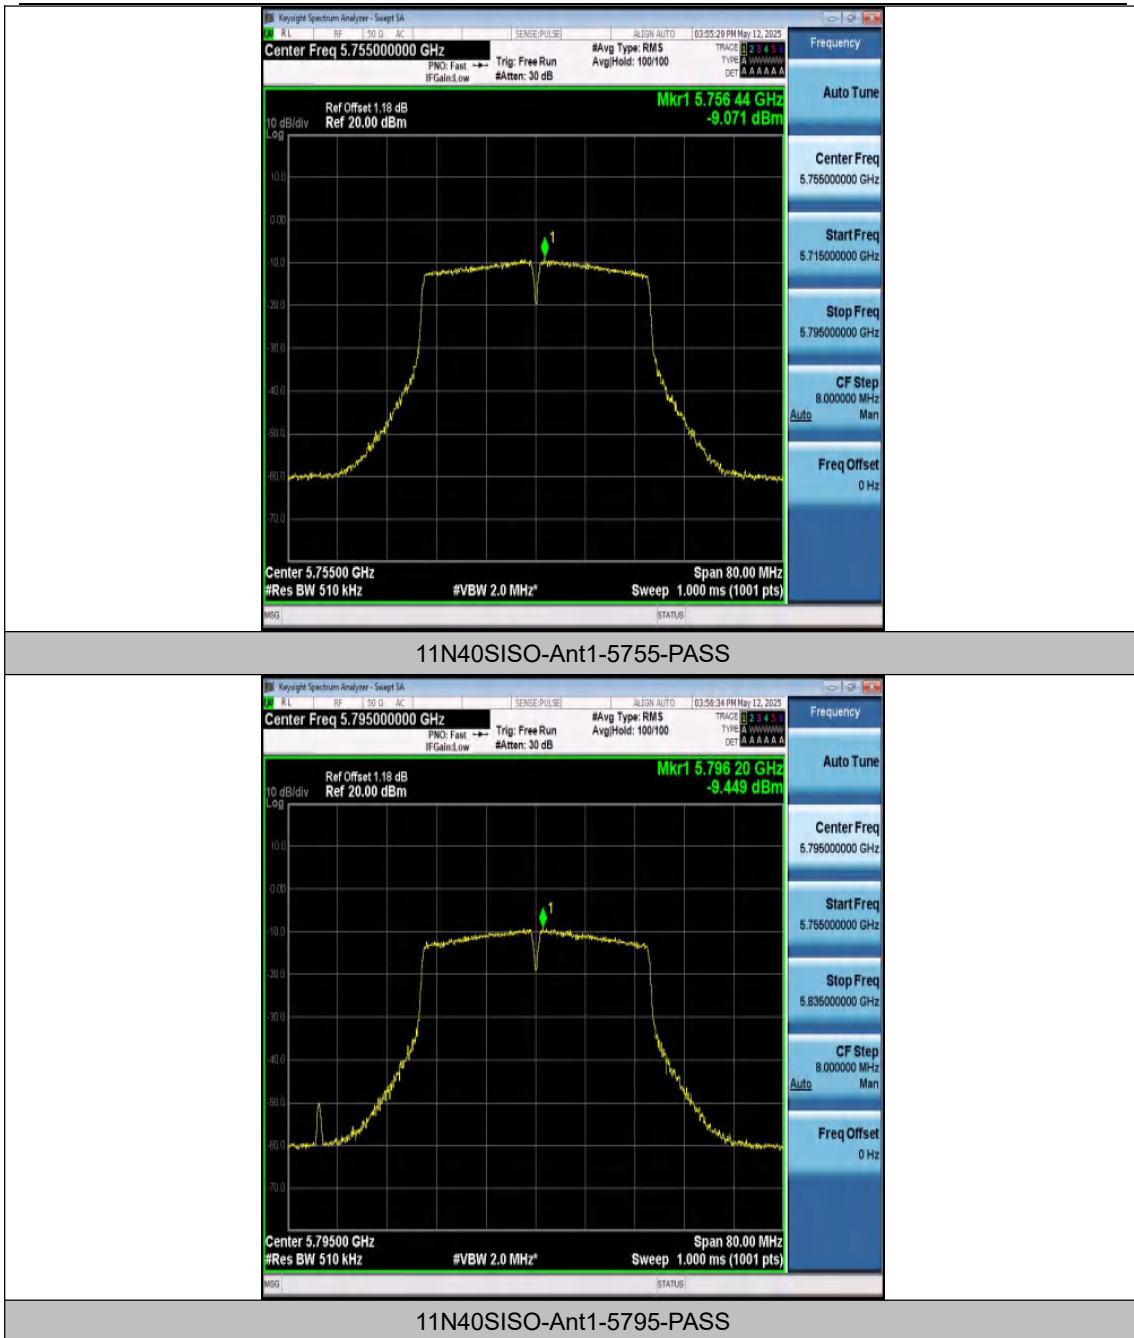

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

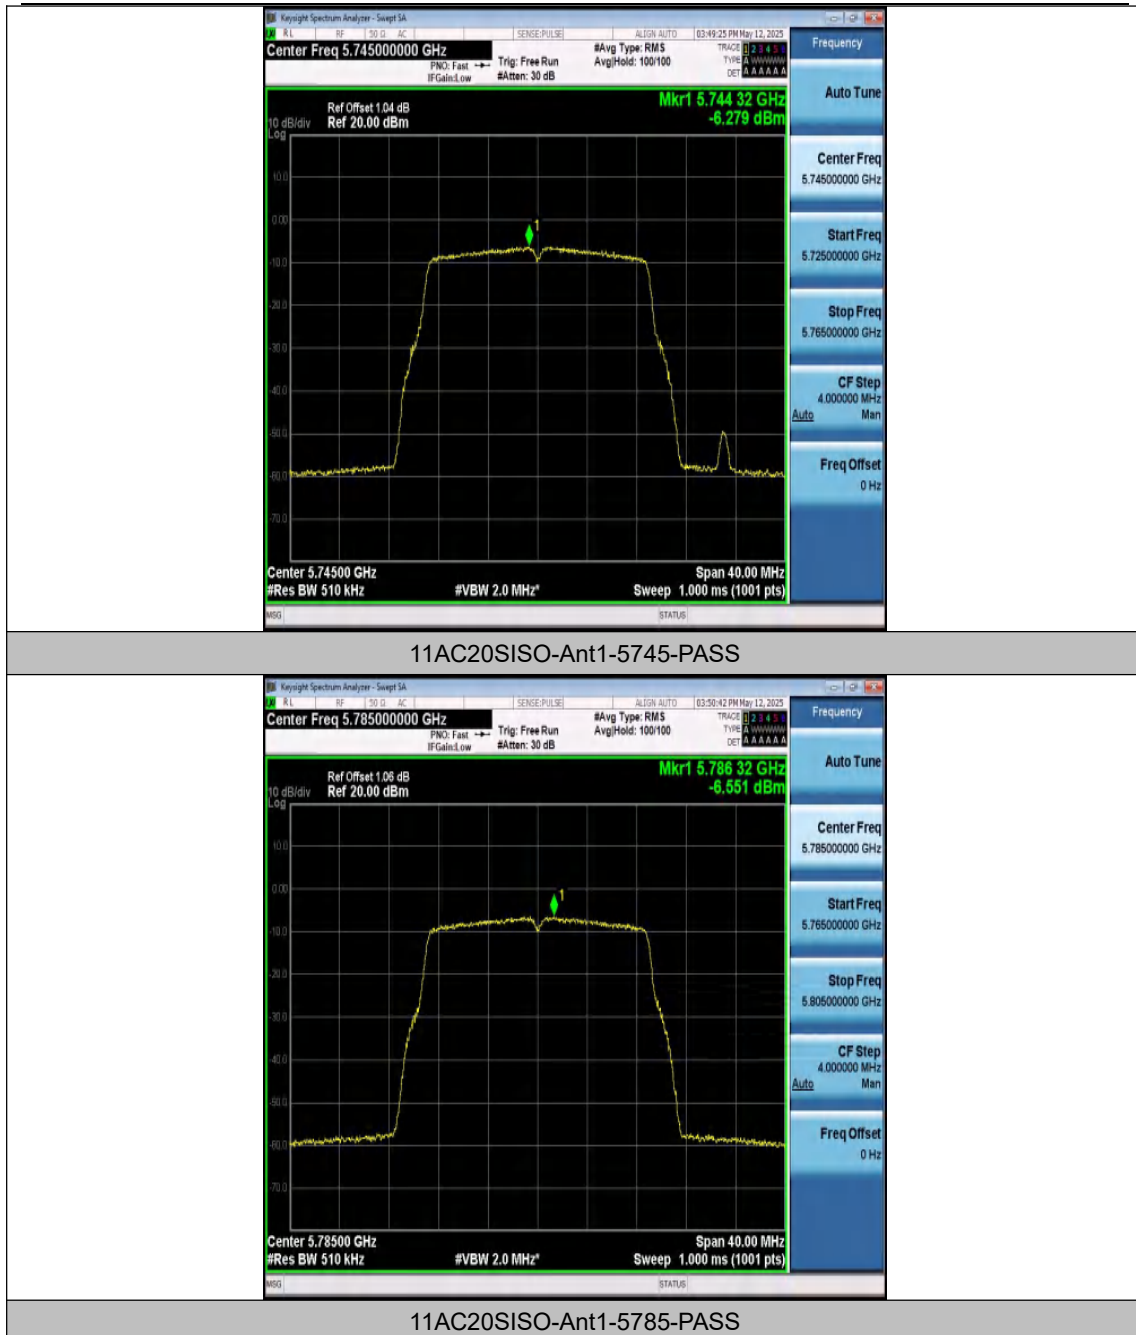

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com


Hotline
400-003-0500
www.anbotek.com

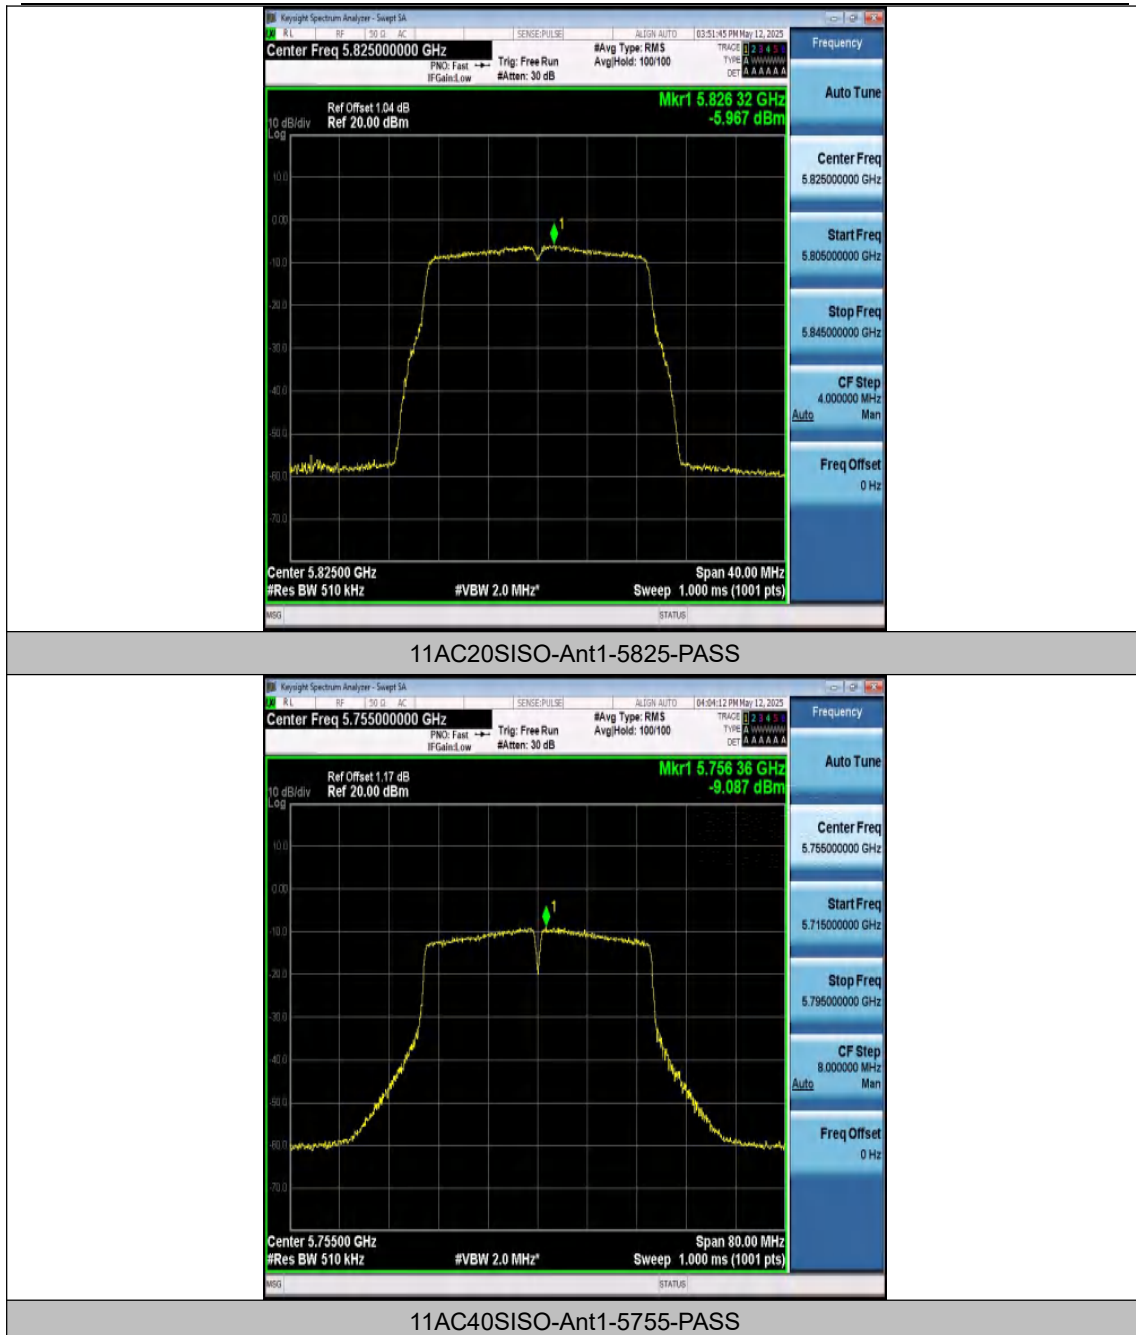

Shenzhen Anbotek Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com

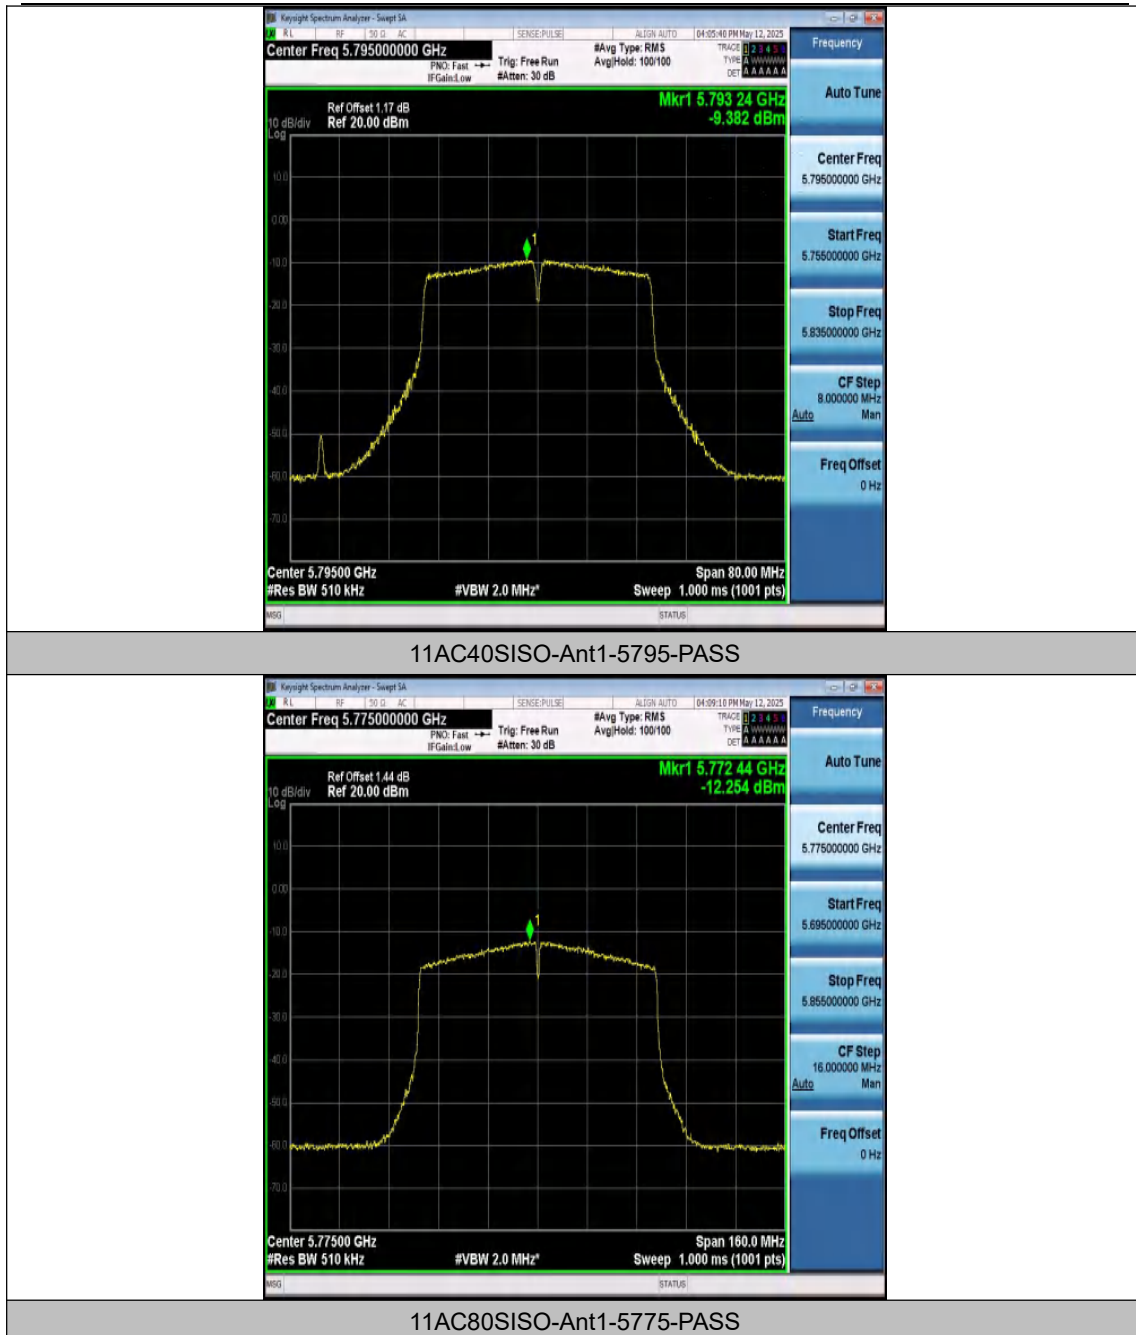

Shenzhen Anbotech Compliance Laboratory Limited

Address: Sogood Industrial Zone Laboratory & 1/F. of Building D, Sogood Science and Technology Park,
Sanwei Community, Hangcheng Subdistrict, Bao'an District, Shenzhen, Guangdong, China
Tel: (86) 0755-26066440 Email: service@anbotech.com

Hotline
400-003-0500
www.anbotech.com

Appendix E: Band edge measurements

Test Result B1

Test Mode	Antenna	ChName	Frequency[MHz]	Result[dBm]	Limit[dBm]	Verdict
11A	Ant1	Low	5180	-44.67	≤-27	PASS
11A	Ant1	High	5240	-45.26	≤-27	PASS
11N20SISO	Ant1	Low	5180	-45.29	≤-27	PASS
11N20SISO	Ant1	High	5240	-45.53	≤-27	PASS
11N40SISO	Ant1	Low	5190	-44.45	≤-27	PASS
11N40SISO	Ant1	High	5230	-45.1	≤-27	PASS
11AC20SISO	Ant1	Low	5180	-43.79	≤-27	PASS
11AC20SISO	Ant1	High	5240	-44.56	≤-27	PASS
11AC40SISO	Ant1	Low	5190	-45	≤-27	PASS
11AC40SISO	Ant1	High	5230	-45.05	≤-27	PASS
11AC80SISO	Ant1	Low	5210	-45.03	≤-27	PASS
11AC80SISO	Ant1	High	5210	-45.5	≤-27	PASS

Note: The margin plus the antenna gain also meets the limit.

Remark: Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.

Test Result B4

Test Mode	Antenna	Ch. Name	Frequency[MHz]	FreqRange [MHz]	Result [dBm]	Limit [dBm]	Verdict
11A	Ant1	Low	5745	5720~5725	-47.79	≤16.60	PASS
11A	Ant1	Low	5745	5700~5720	-45.78	≤11.47	PASS
11A	Ant1	Low	5745	5650~5700	-47.24	≤-26.45	PASS
11A	Ant1	Low	5745	5760~5650	-46.98	≤-27	PASS
11A	Ant1	High	5825	5850~5855	-48.01	≤15.73	PASS
11A	Ant1	High	5825	5855~5875	-47.38	≤10.74	PASS
11A	Ant1	High	5825	5875~5925	-47.49	≤-25.71	PASS
11A	Ant1	High	5825	5925~5935	-46.97	≤-27	PASS
11N20SI SO	Ant1	Low	5745	5720~5725	-48.03	≤15.82	PASS
11N20SI SO	Ant1	Low	5745	5700~5720	-46.88	≤10.41	PASS
11N20SI SO	Ant1	Low	5745	5650~5700	-48.18	≤-26.87	PASS
11N20SI SO	Ant1	Low	5745	5760~5650	-46.87	≤-27	PASS
11N20SI SO	Ant1	High	5825	5850~5855	-48.22	≤15.73	PASS
11N20SI SO	Ant1	High	5825	5855~5875	-46.06	≤11.12	PASS
11N20SI SO	Ant1	High	5825	5875~5925	-48.44	≤-26.51	PASS
11N20SI SO	Ant1	High	5825	5925~5935	-46.99	≤-27	PASS
11N40SI SO	Ant1	Low	5755	5720~5725	-45.07	≤16.04	PASS
11N40SI SO	Ant1	Low	5755	5700~5720	-47.63	≤10.06	PASS
11N40SI SO	Ant1	Low	5755	5650~5700	-48.25	≤-26.80	PASS
11N40SI SO	Ant1	Low	5755	5780~5650	-46.89	≤-27	PASS
11N40SI SO	Ant1	High	5795	5850~5855	-48.57	≤15.66	PASS
11N40SI SO	Ant1	High	5795	5855~5875	-47.96	≤10.11	PASS
11N40SI SO	Ant1	High	5795	5875~5925	-48.12	≤-26.46	PASS

Shenzhen Anbotech Compliance Laboratory Limited


11N40SI SO	Ant1	High	5795	5925~5935	-45.75	≤-27	PASS
11AC20S ISO	Ant1	Low	5745	5720~5725	-46.27	≤16.87	PASS
11AC20S ISO	Ant1	Low	5745	5700~5720	-45.52	≤10.57	PASS
11AC20S ISO	Ant1	Low	5745	5650~5700	-48.06	≤-26.96	PASS
11AC20S ISO	Ant1	Low	5745	5760~5650	-46.93	≤-27	PASS
11AC20S ISO	Ant1	High	5825	5850~5855	-48.71	≤15.73	PASS
11AC20S ISO	Ant1	High	5825	5855~5875	-47.53	≤10.70	PASS
11AC20S ISO	Ant1	High	5825	5875~5925	-48.36	≤-26.71	PASS
11AC20S ISO	Ant1	High	5825	5925~5935	-46.28	≤-27	PASS
11AC40S ISO	Ant1	Low	5755	5720~5725	-44.27	≤18.51	PASS
11AC40S ISO	Ant1	Low	5755	5700~5720	-47.21	≤10.55	PASS
11AC40S ISO	Ant1	Low	5755	5650~5700	-47.81	≤-26.70	PASS
11AC40S ISO	Ant1	Low	5755	5780~5650	-47.26	≤-27	PASS
11AC40S ISO	Ant1	High	5795	5850~5855	-47.79	≤15.66	PASS
11AC40S ISO	Ant1	High	5795	5855~5875	-48.49	≤10.16	PASS
11AC40S ISO	Ant1	High	5795	5875~5925	-48.61	≤-26.95	PASS
11AC40S ISO	Ant1	High	5795	5925~5935	-46.79	≤-27	PASS
11AC80S ISO	Ant1	Low	5775	5720~5725	-46.34	≤16.35	PASS
11AC80S ISO	Ant1	Low	5775	5700~5720	-47.21	≤10.40	PASS
11AC80S ISO	Ant1	Low	5775	5650~5700	-46.98	≤-26.69	PASS
11AC80S ISO	Ant1	Low	5775	5800~5650	-47.51	≤-27	PASS
11AC80S	Ant1	High	5775	5850~5855	-49.26	≤16.26	PASS


Shenzhen Anbotech Compliance Laboratory Limited


ISO							
11AC80S ISO	Ant1	High	5775	5855~5875	-47.21	≤ 11.23	PASS
11AC80S ISO	Ant1	High	5775	5875~5925	-46.52	≤ -26.60	PASS
11AC80S ISO	Ant1	High	5775	5925~5935	-47	≤ -27	PASS


Note: The margin plus the antenna gain also meets the limit.


Test Graphs B1

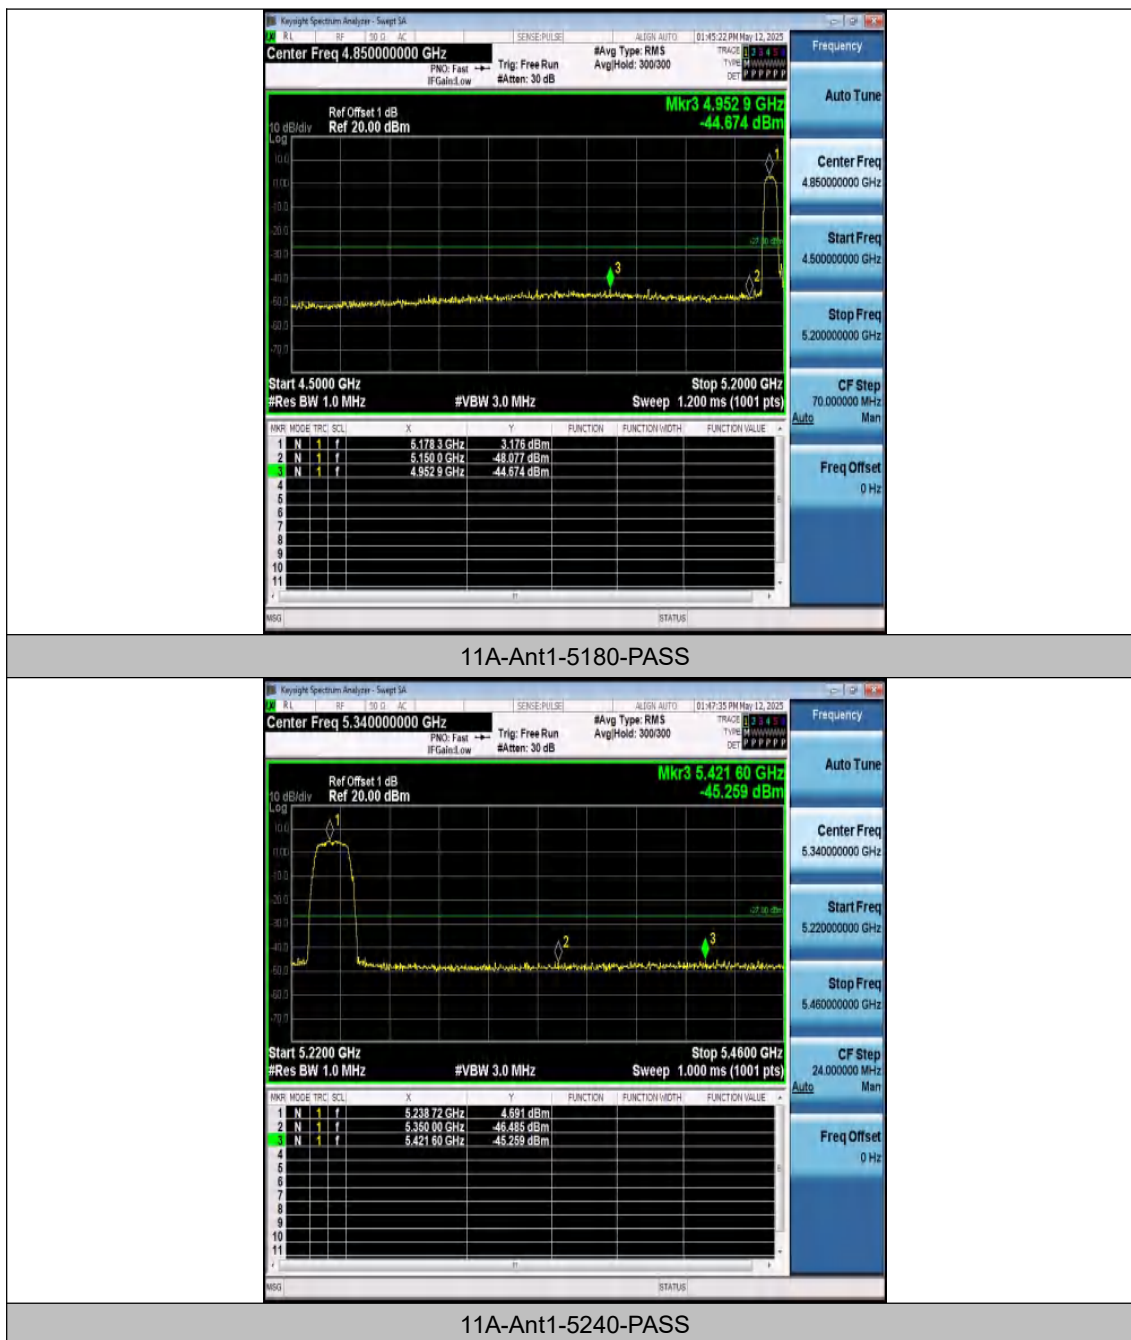


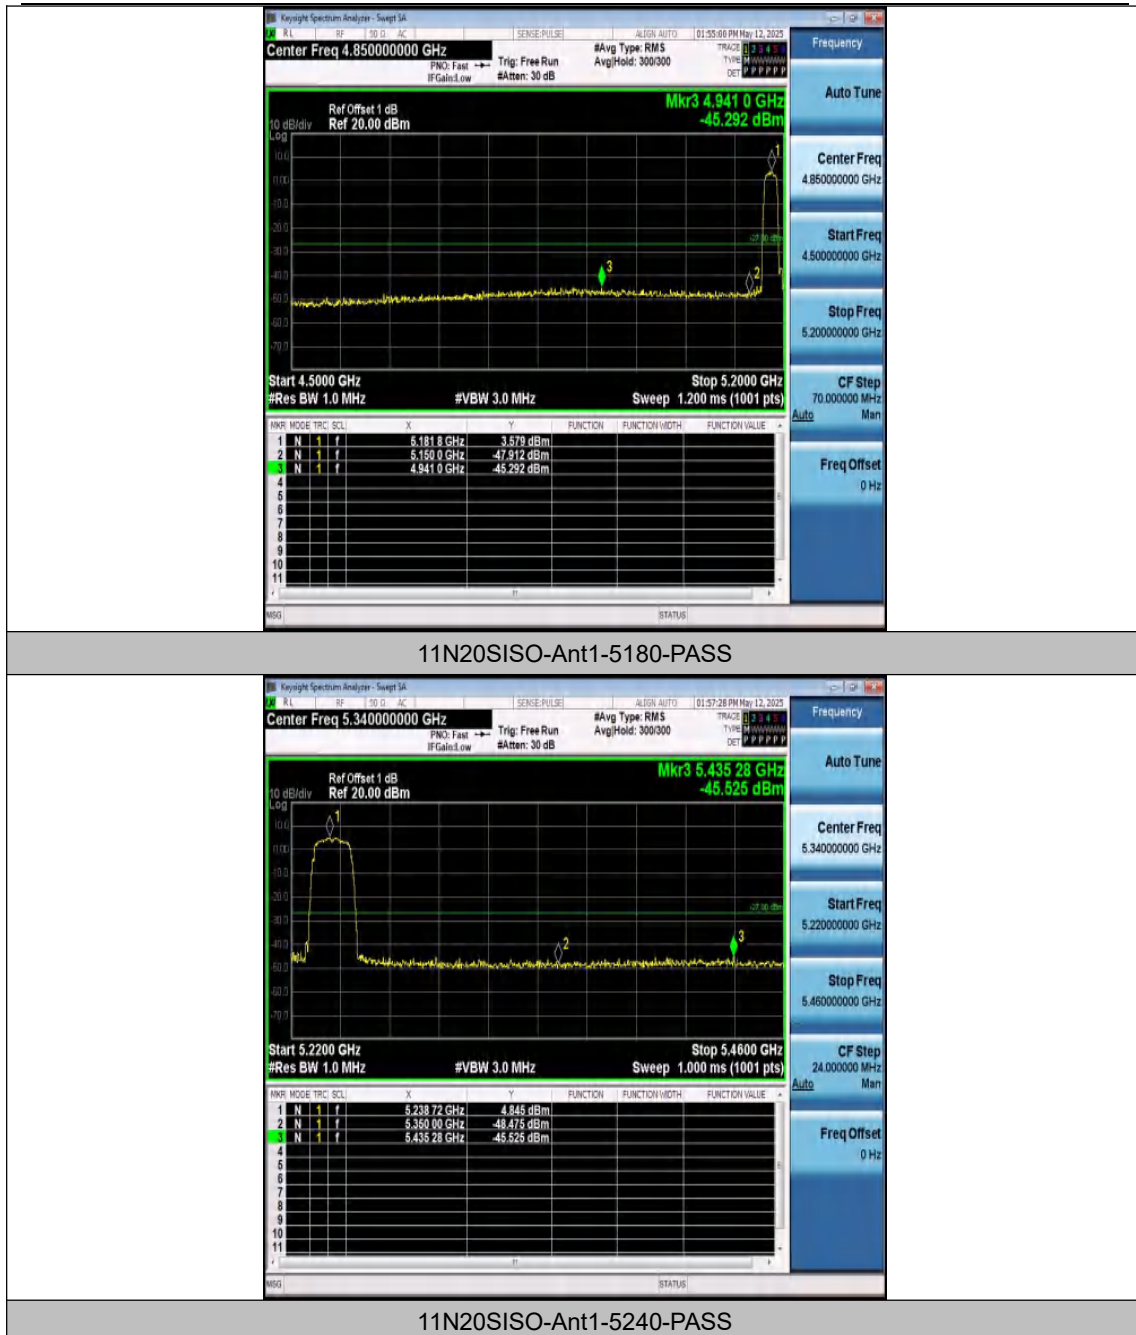

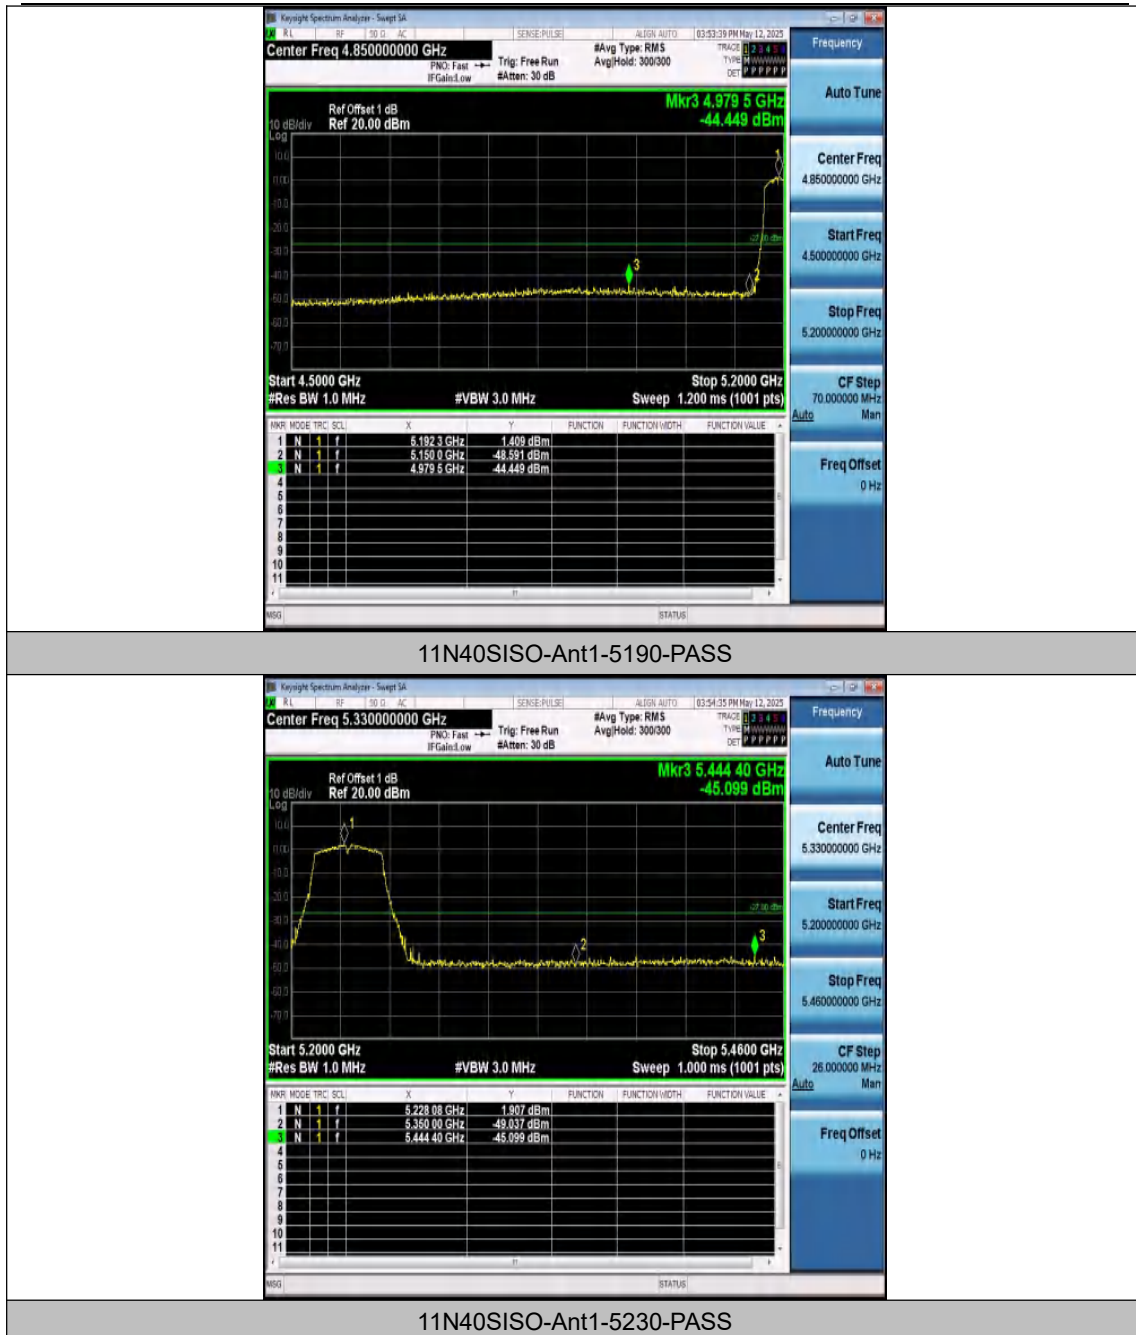


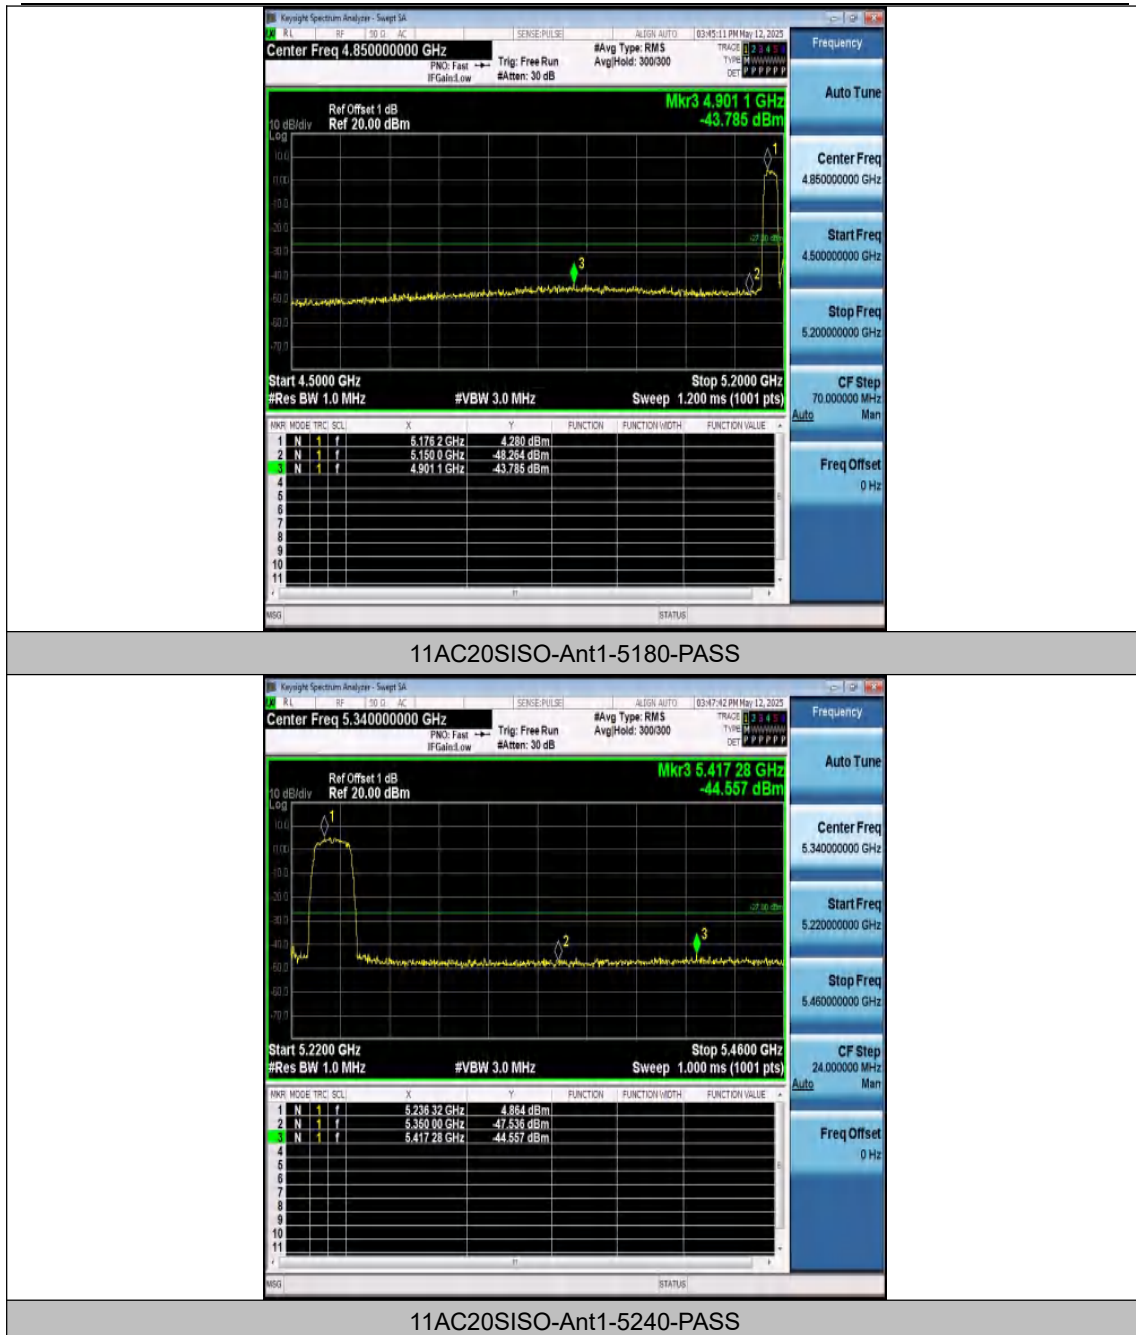


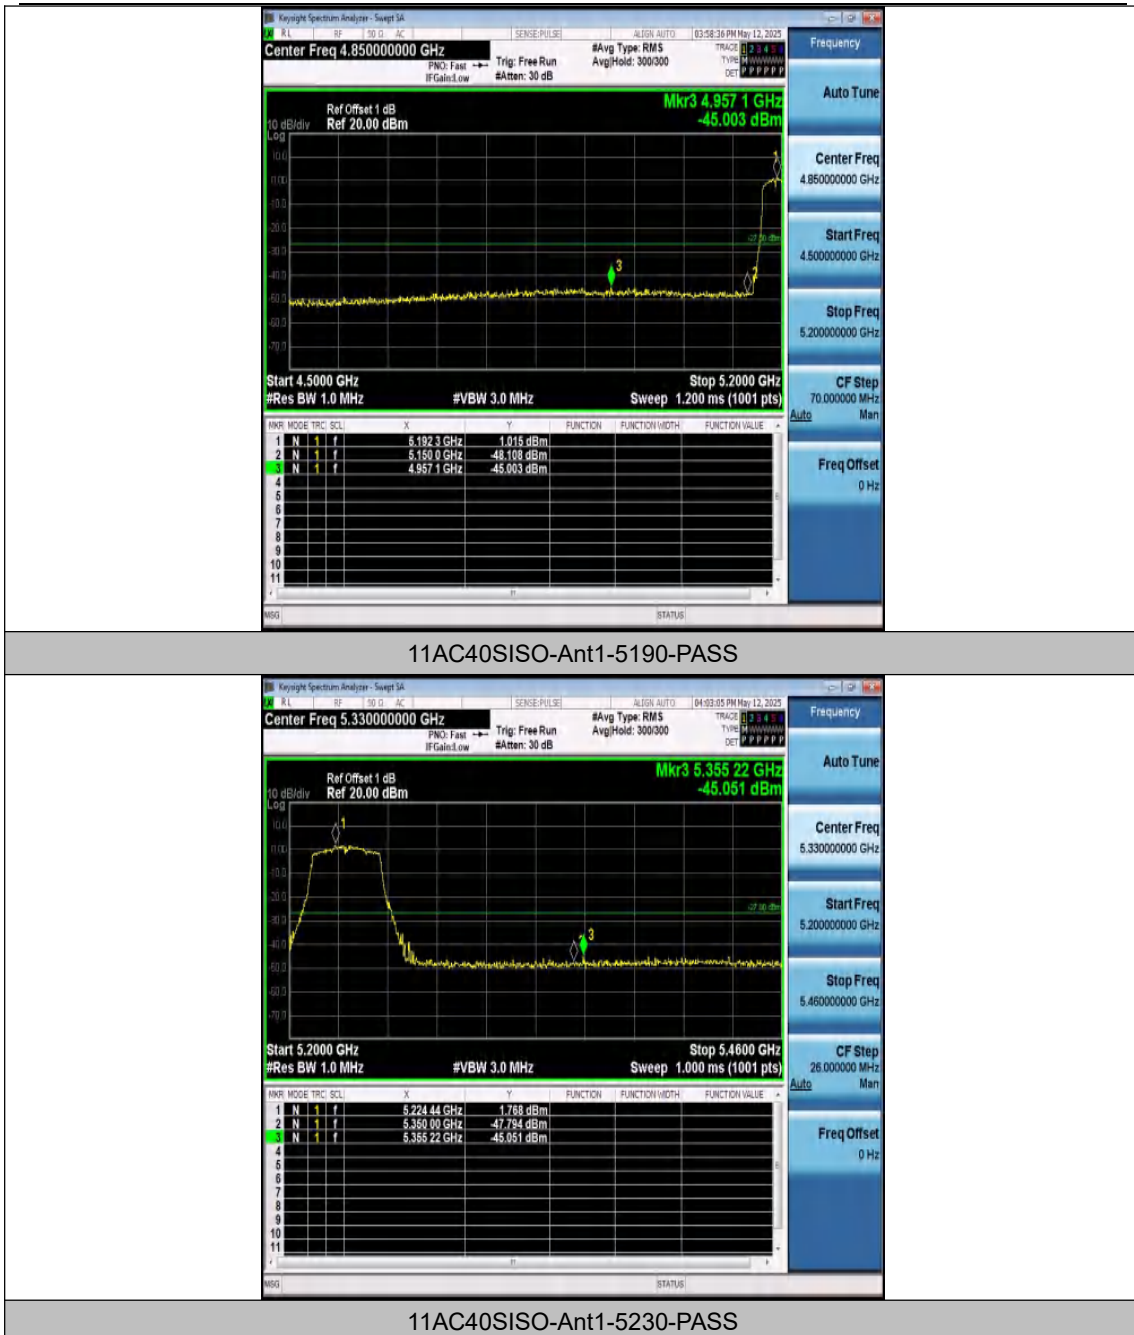


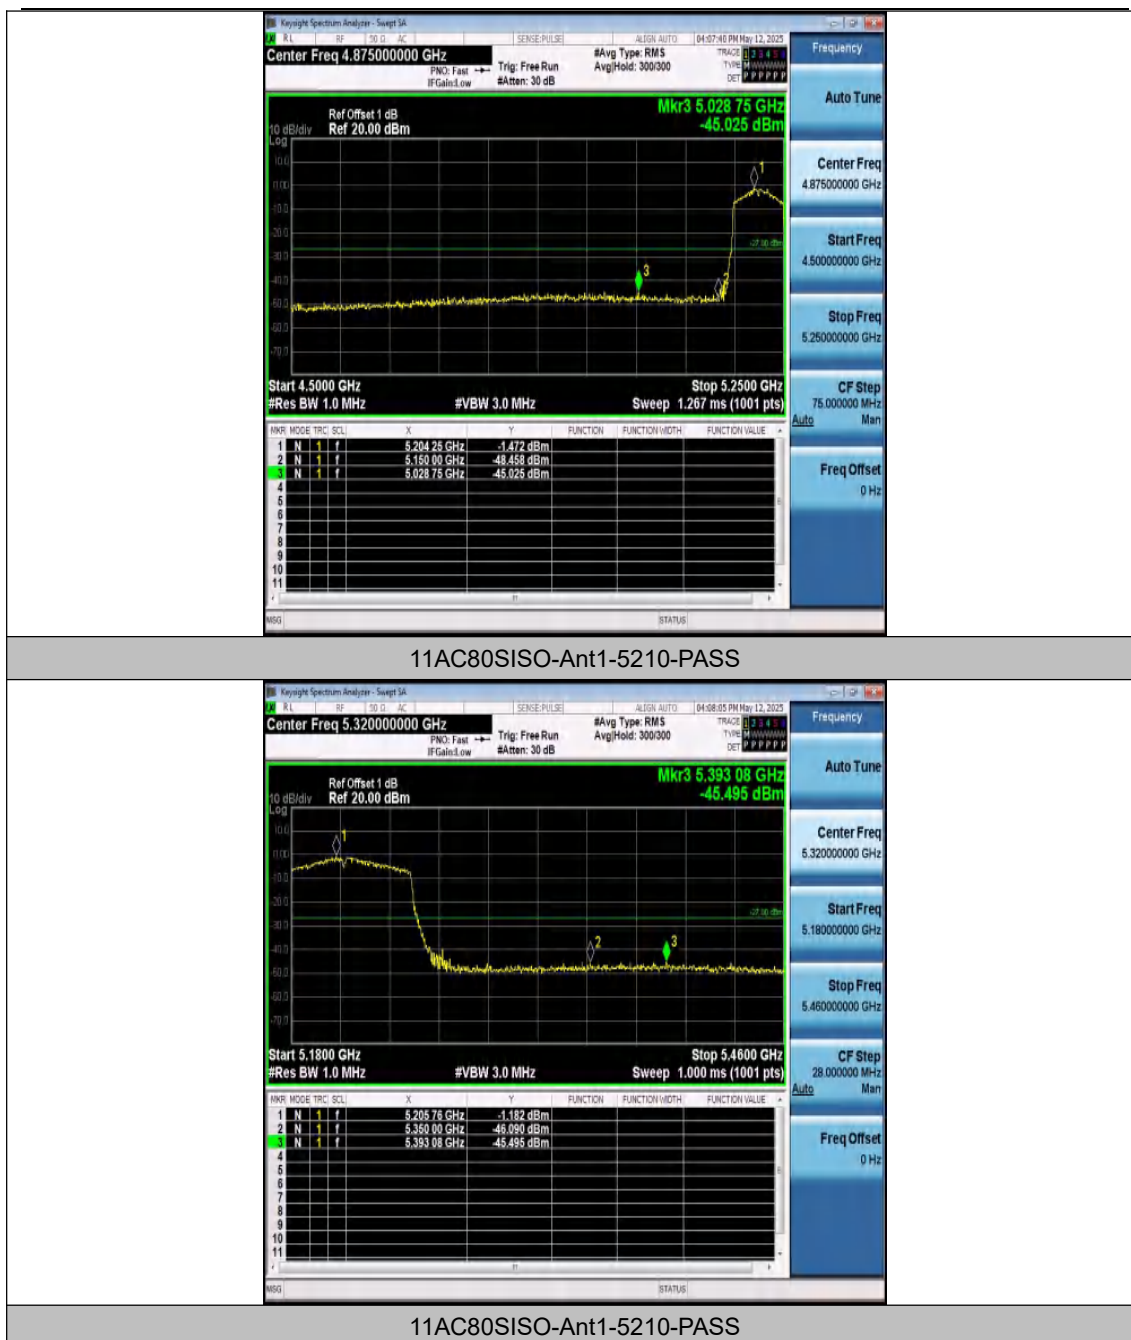



Test Graphs B4

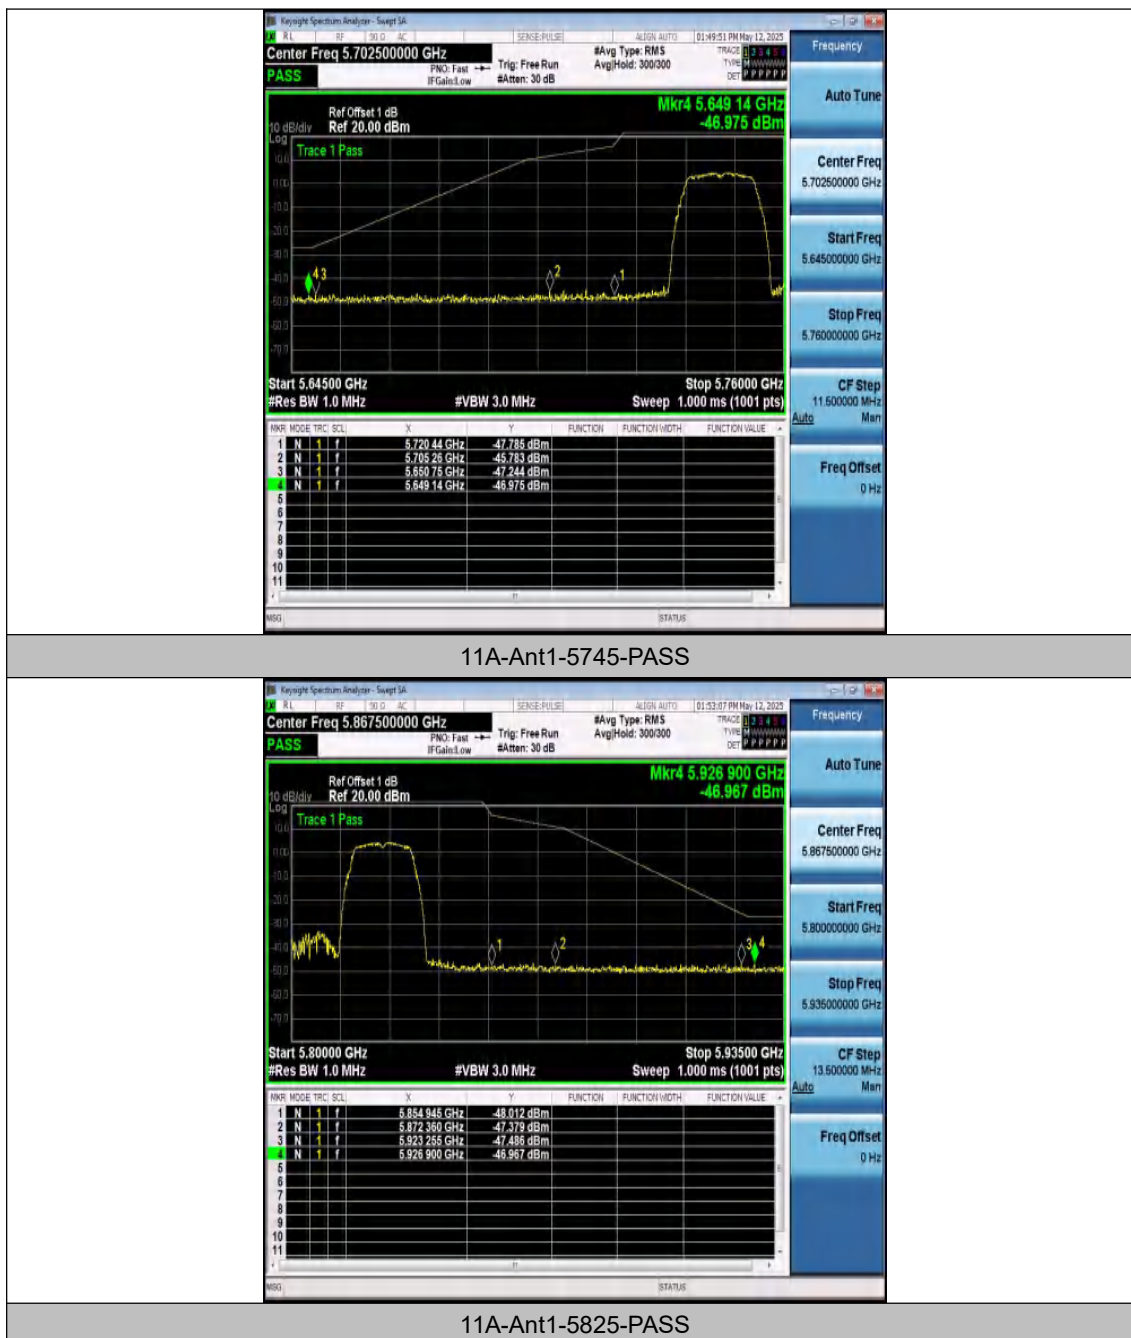


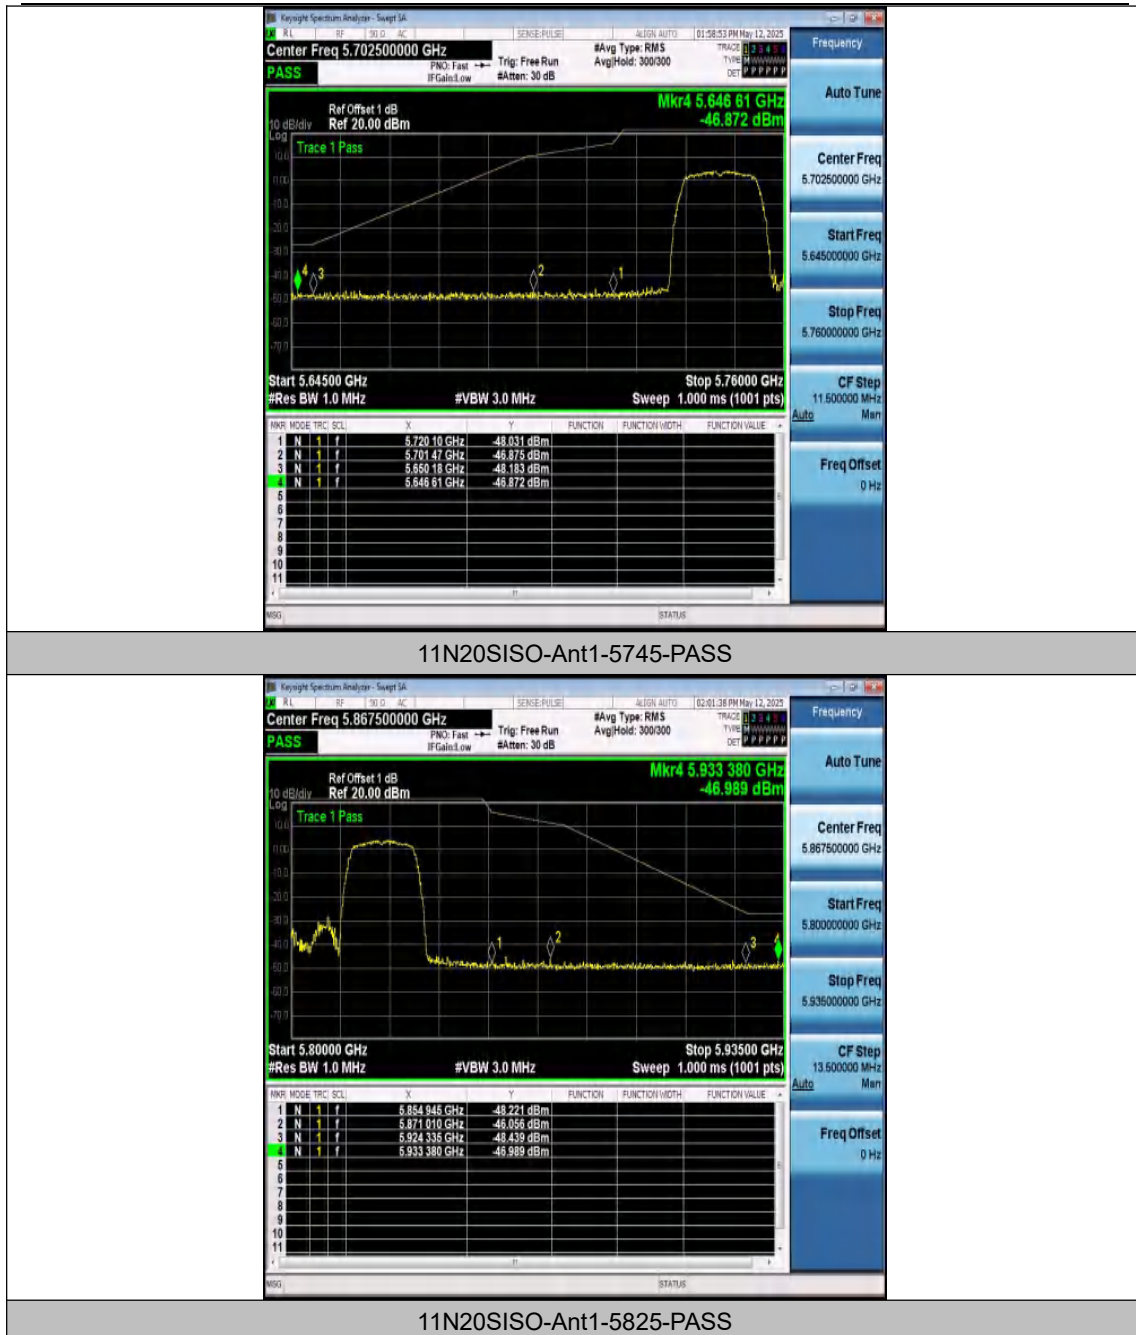

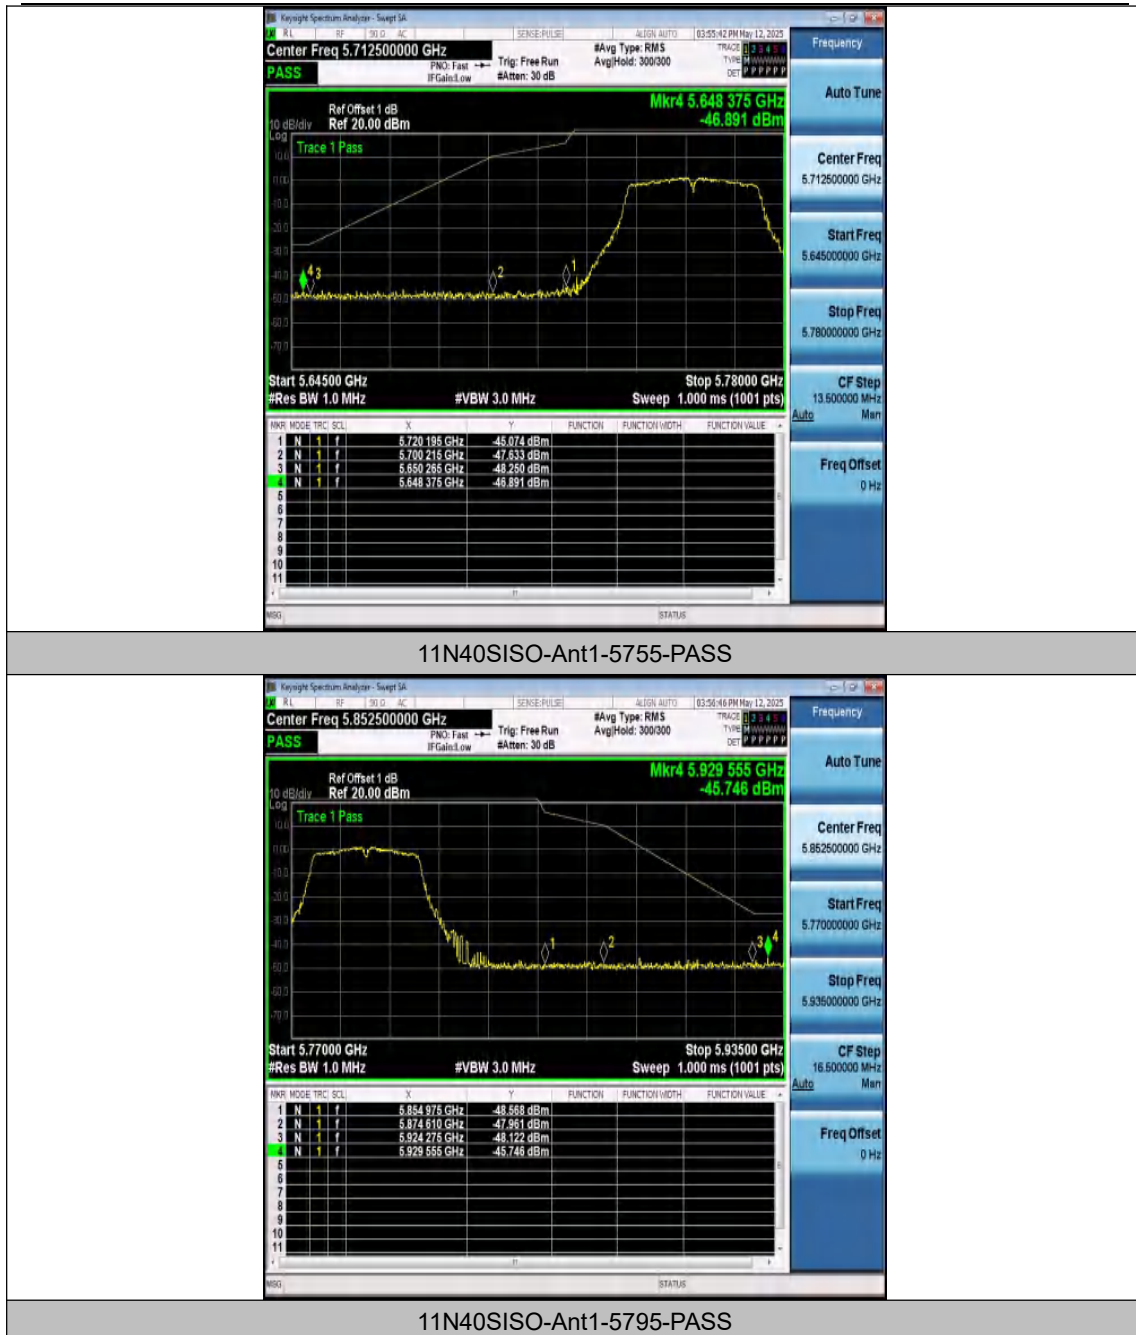

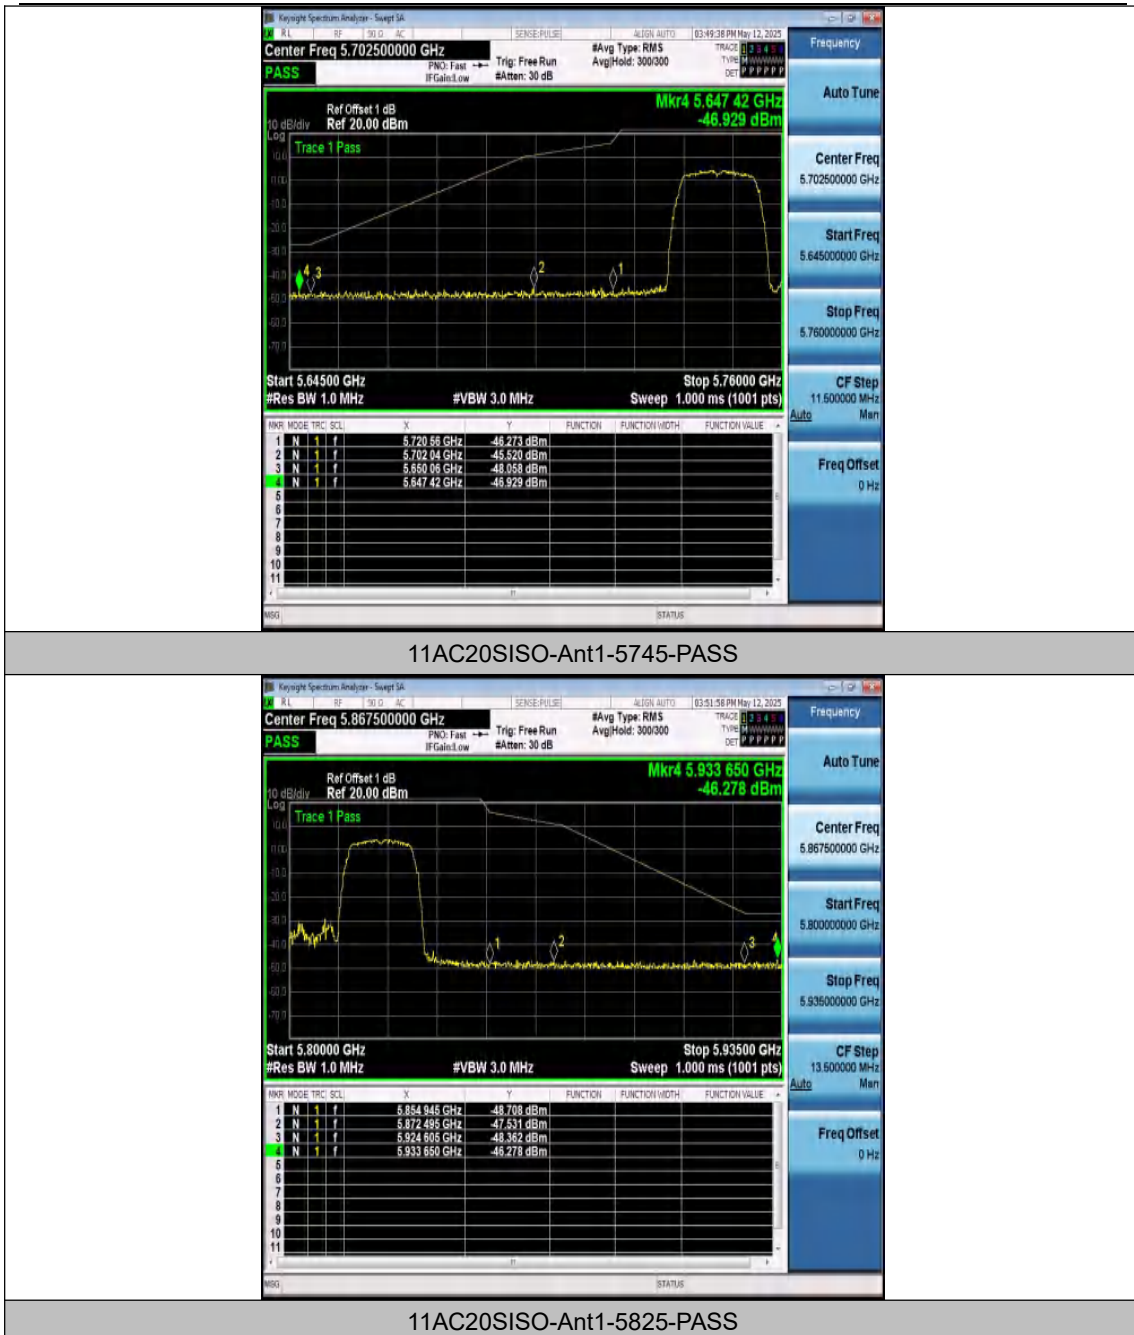

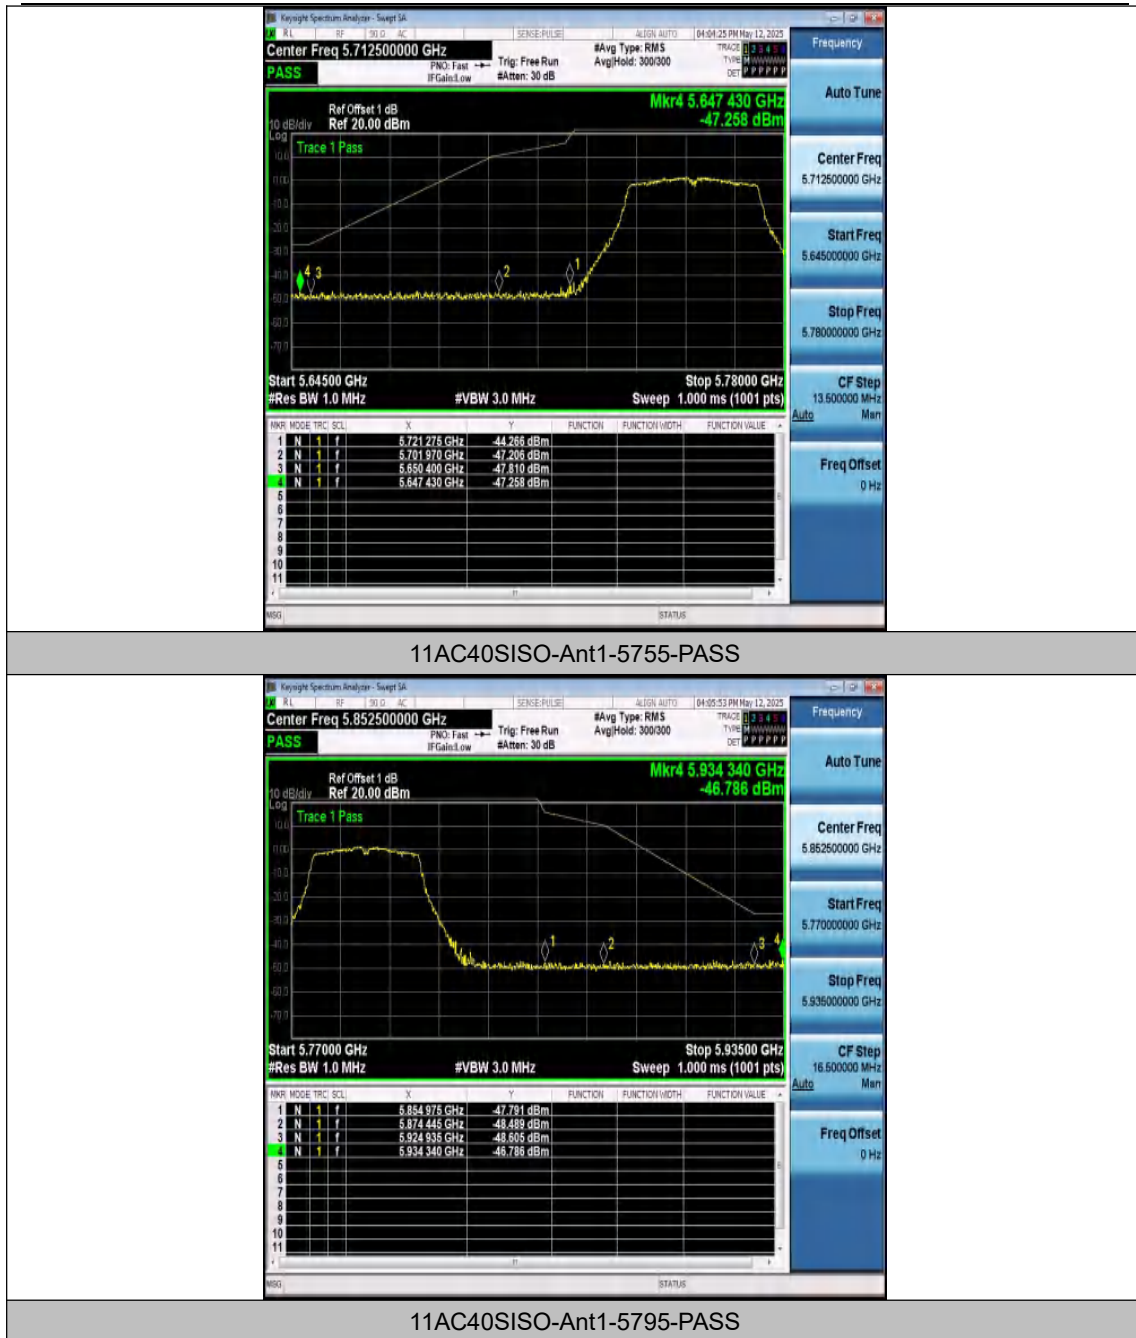

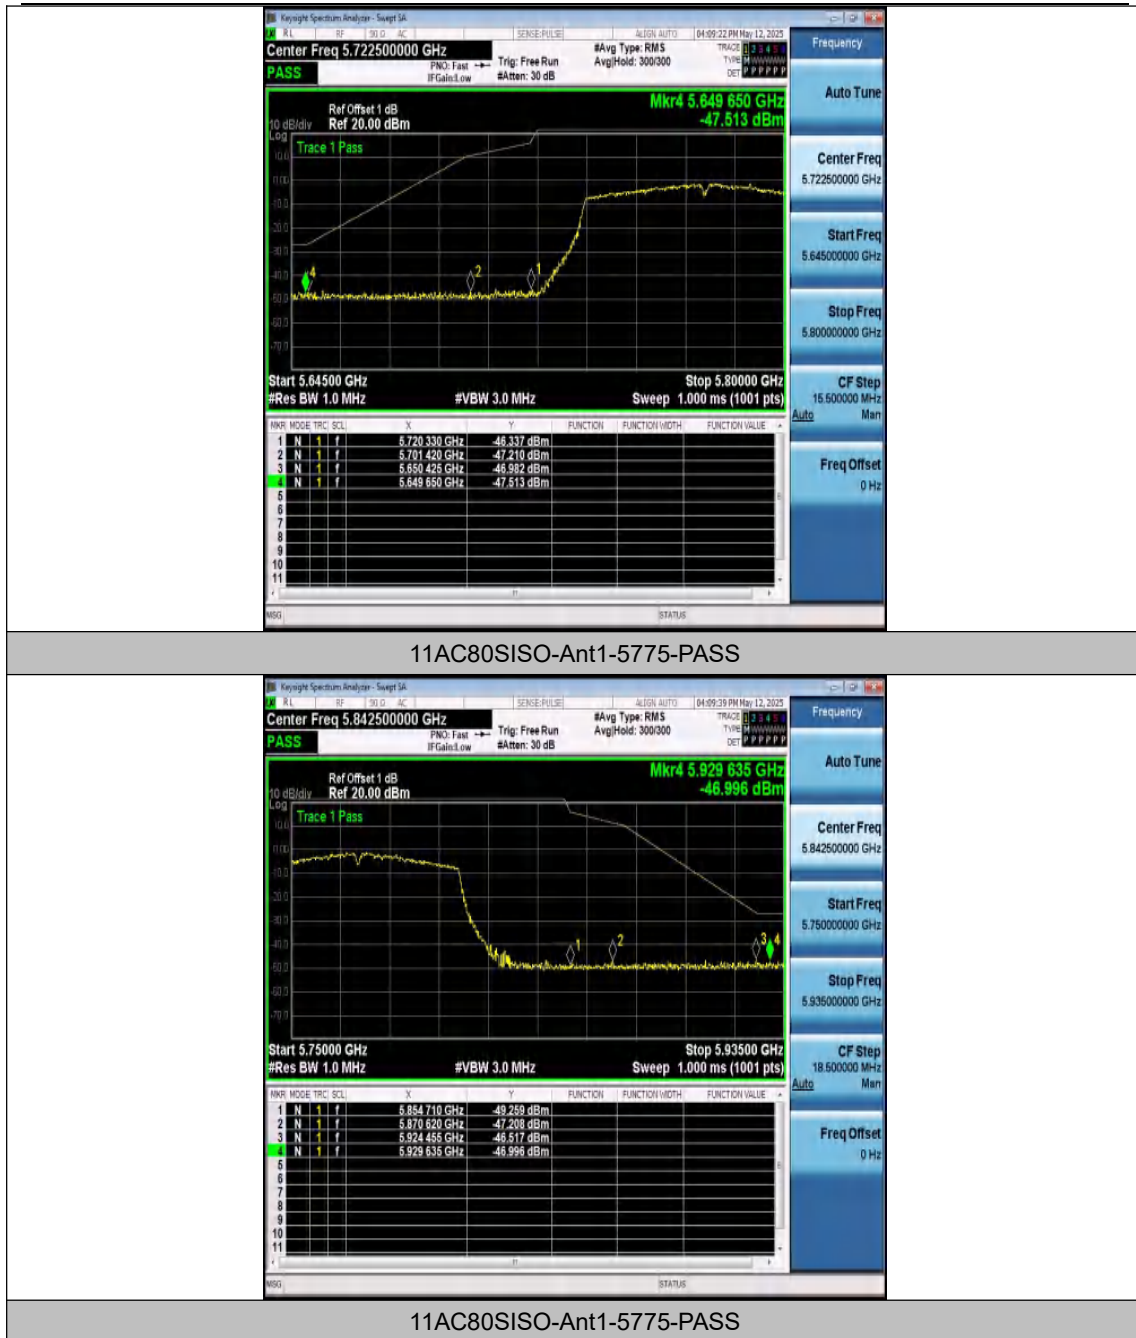

---End---