

Spurious Emissions at Antenna Terminal**FCC For 90S****LTE B26_1, Normal**

Mode	Value (dBm)	Limit	Verdict
1.4MHz_Low_QPSK_1@0(30MHz~9.24GHz)	-33.56	See Graphs	Pass
1.4MHz_Low_QPSK_6@0(30MHz~9.24GHz)	-33.24	See Graphs	Pass
1.4MHz_High_QPSK_1@0(30MHz~9.24GHz)	-33.55	See Graphs	Pass
1.4MHz_High_QPSK_6@0(30MHz~9.24GHz)	-33.33	See Graphs	Pass
3MHz_Low_QPSK_1@0(30MHz~9.24GHz)	-33.50	See Graphs	Pass
3MHz_Low_QPSK_15@0(30MHz~9.24GHz)	-33.25	See Graphs	Pass
3MHz_High_QPSK_1@0(30MHz~9.24GHz)	-32.52	See Graphs	Pass
3MHz_High_QPSK_15@0(30MHz~9.24GHz)	-33.27	See Graphs	Pass
5MHz_Low_QPSK_1@0(30MHz~9.24GHz)	-33.10	See Graphs	Pass
5MHz_Low_QPSK_25@0(30MHz~9.24GHz)	-32.69	See Graphs	Pass
5MHz_High_QPSK_1@0(30MHz~9.24GHz)	-32.61	See Graphs	Pass
5MHz_High_QPSK_25@0(30MHz~9.24GHz)	-33.38	See Graphs	Pass
10MHz_Low_QPSK_1@0(30MHz~9.24GHz)	-33.51	See Graphs	Pass
10MHz_Low_QPSK_50@0(30MHz~9.24GHz)	-32.96	See Graphs	Pass
15MHz_Low_QPSK_1@0(30MHz~9.24GHz)	-33.70	See Graphs	Pass
15MHz_Low_QPSK_75@0(30MHz~9.24GHz)	-32.60	See Graphs	Pass

LTE B26_Cross channel, Normal


Mode	Value (dBm)	Limit	Verdict
1.4MHz_Middle_QPSK_1@0(30MHz~9.24GHz)	-32.70	See Graphs	Pass
1.4MHz_Middle_QPSK_6@0(30MHz~9.24GHz)	-33.36	See Graphs	Pass
3MHz_Middle_QPSK_1@0(30MHz~9.24GHz)	-33.47	See Graphs	Pass
3MHz_Middle_QPSK_15@0(30MHz~9.24GHz)	-33.04	See Graphs	Pass
5MHz_Middle_QPSK_1@0(30MHz~9.24GHz)	-33.36	See Graphs	Pass
5MHz_Middle_QPSK_25@0(30MHz~9.24GHz)	-33.18	See Graphs	Pass
10MHz_Middle_QPSK_1@0(30MHz~9.24GHz)	-33.39	See Graphs	Pass
10MHz_Middle_QPSK_50@0(30MHz~9.24GHz)	-32.73	See Graphs	Pass
15MHz_Middle_QPSK_1@0(30MHz~9.24GHz)	-33.47	See Graphs	Pass
15MHz_Middle_QPSK_75@0(30MHz~9.24GHz)	-33.56	See Graphs	Pass

Note:1RB was the worst case.

LTE B26_1, Normal


1RB was the worst case

1.4MHz_Low_QPSK_1@0(30MHz~9.24GHz)

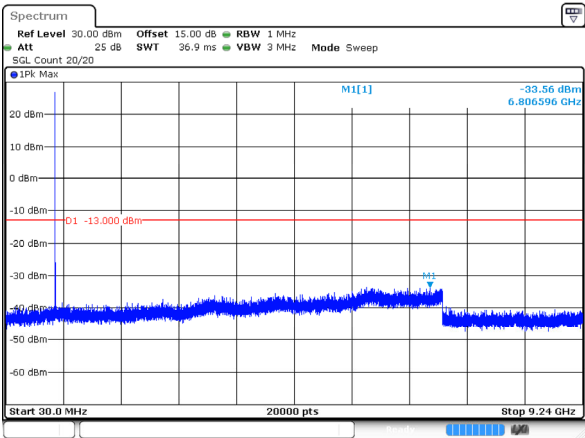


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 10:59:04

1.4MHz_Low_QPSK_6@0(30MHz~9.24GHz)

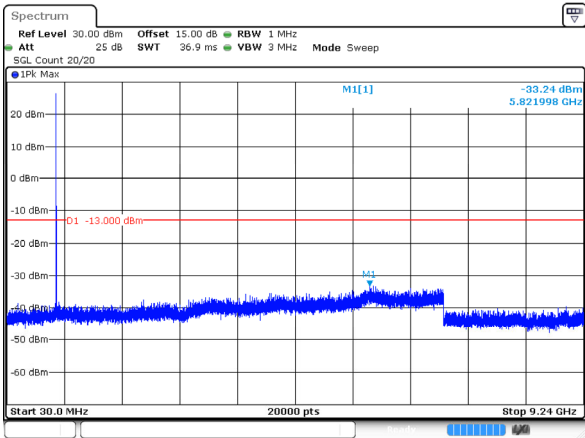


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 10:59:20

1.4MHz_High_QPSK_1@0(30MHz~9.24GHz)

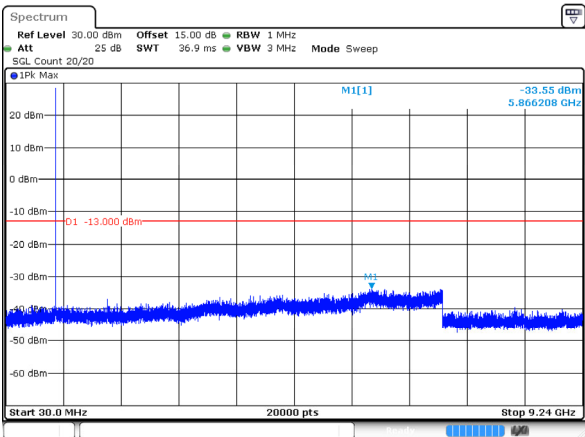


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 10:59:37

1.4MHz_High_QPSK_6@0(30MHz~9.24GHz)

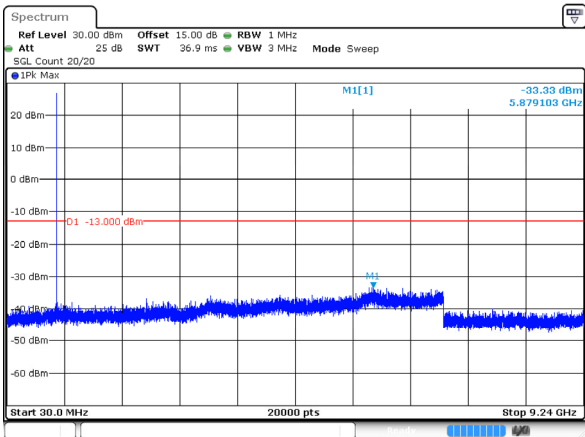


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 10:59:52

3MHz_Low_QPSK_1@0(30MHz~9.24GHz)

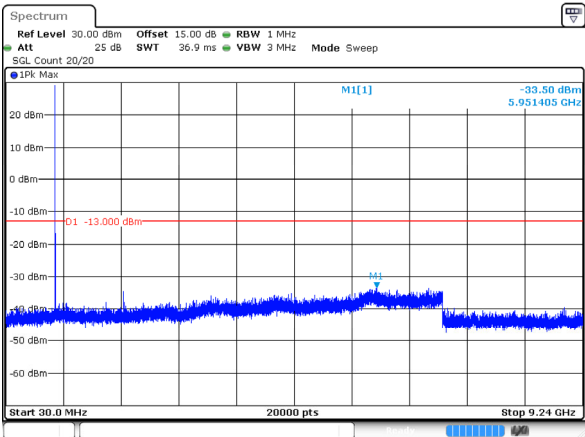

ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:00:13


3MHz_Low_QPSK_15@0(30MHz~9.24GHz)

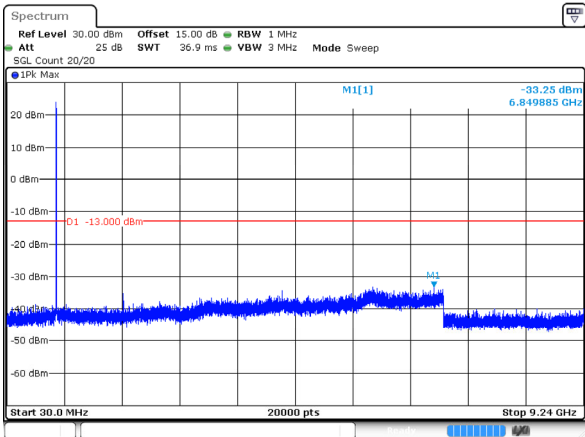


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:00:30

3MHz_High_QPSK_1@0(30MHz~9.24GHz)

3MHz_High_QPSK_15@0(30MHz~9.24GHz)

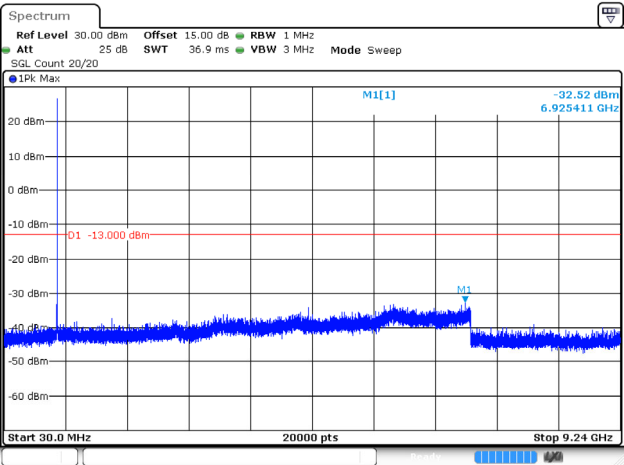


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:00:47

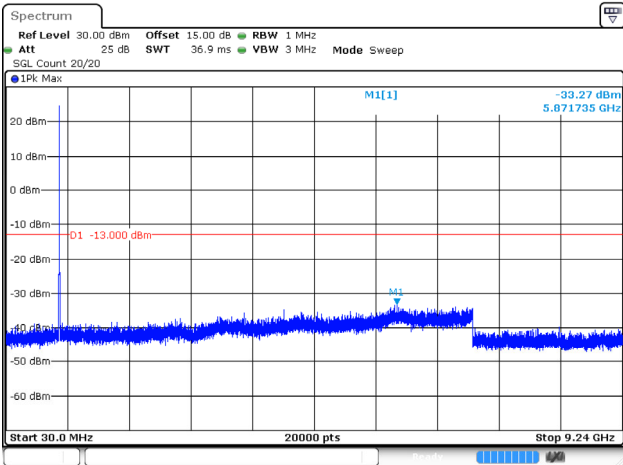


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:01:03

5MHz_Low_QPSK_1@0(30MHz~9.24GHz)

5MHz_Low_QPSK_25@0(30MHz~9.24GHz)

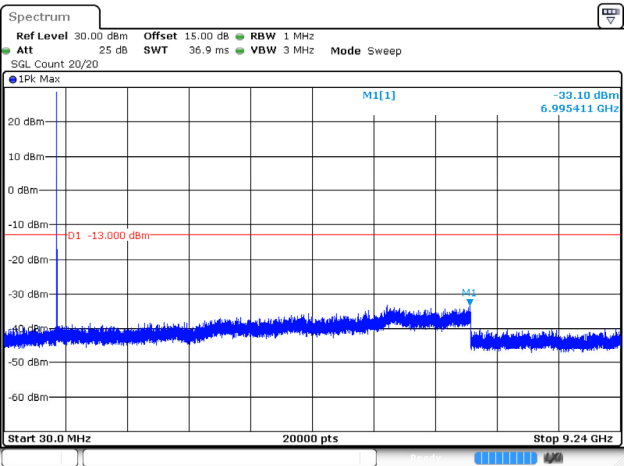


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:01:21

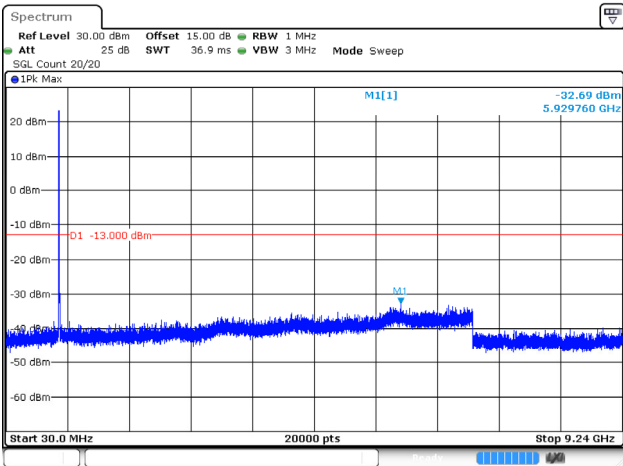


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:01:36

5MHz_High_QPSK_1@0(30MHz~9.24GHz)

5MHz_High_QPSK_25@0(30MHz~9.24GHz)

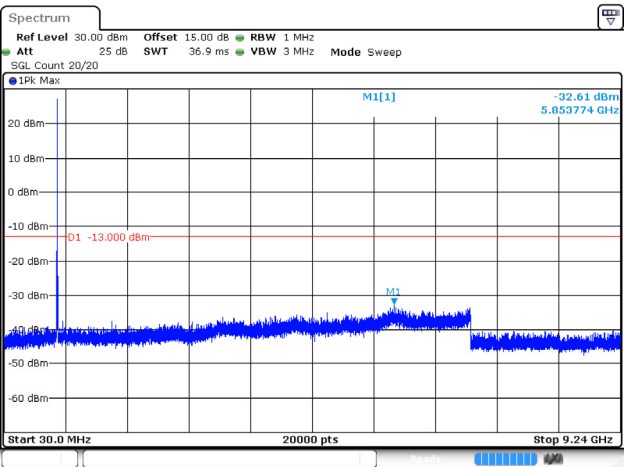


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:01:53

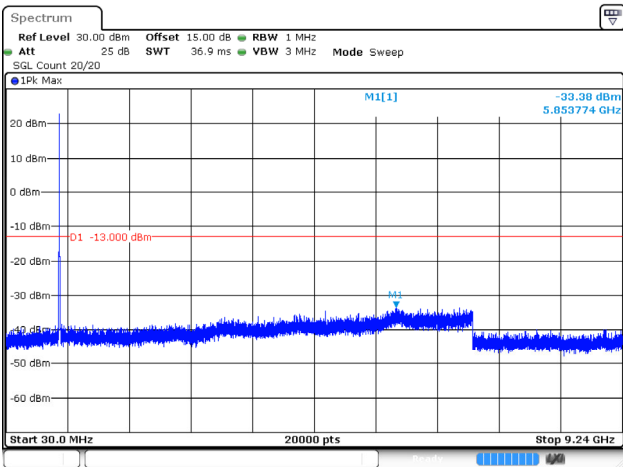


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:02:11

10MHz_Low_QPSK_1@0(30MHz~9.24GHz)

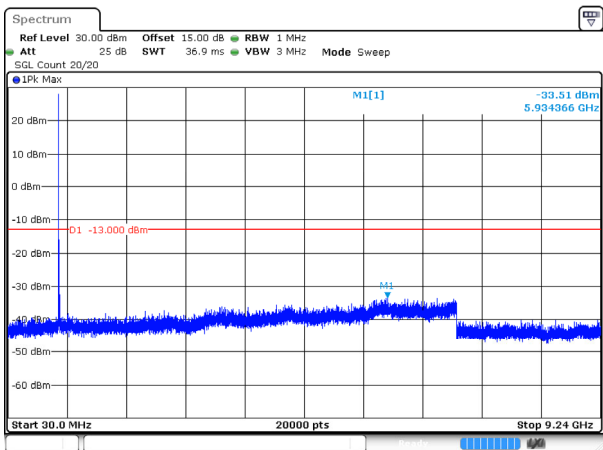


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21.JUL.2025 11:02:30

10MHz_Low_QPSK_50@0(30MHz~9.24GHz)

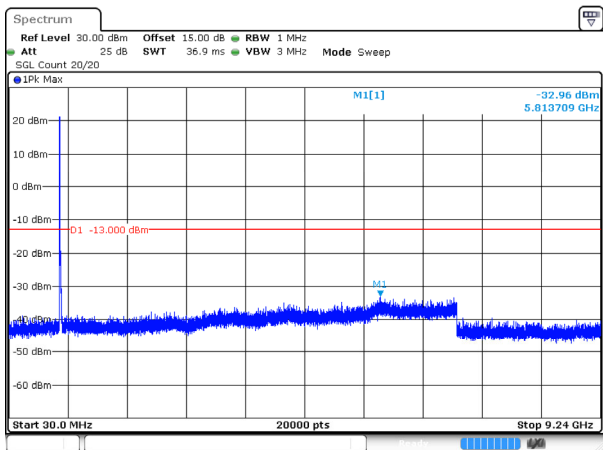


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21.JUL.2025 11:02:45

15MHz_Low_QPSK_1@0(30MHz~9.24GHz)

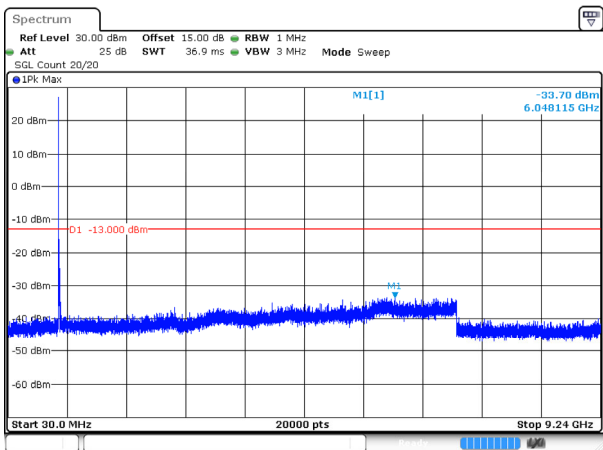

ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21.JUL.2025 11:03:35


15MHz_Low_QPSK_75@0(30MHz~9.24GHz)

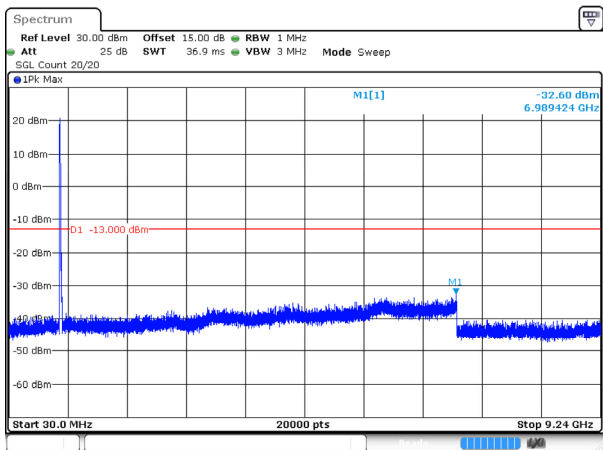

ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21.JUL.2025 11:03:51


LTE B26_3, Normal
1RB was the worst case

1.4MHz_Middle_QPSK_1@0(30MHz~9.24GHz)

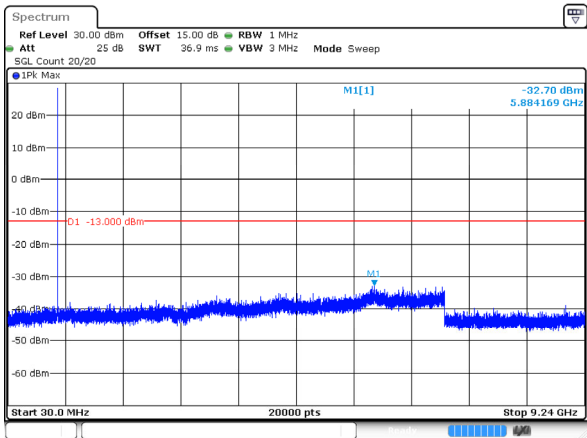


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21.JUL.2025 11:04:20

1.4MHz_Middle_QPSK_6@0(30MHz~9.24GHz)

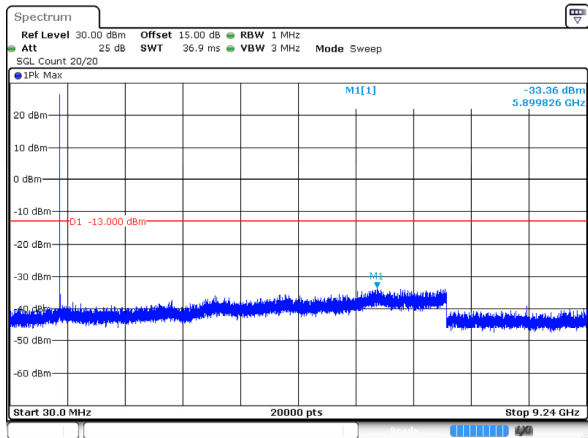


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21.JUL.2025 11:04:36

3MHz_Middle_QPSK_1@0(30MHz~9.24GHz)

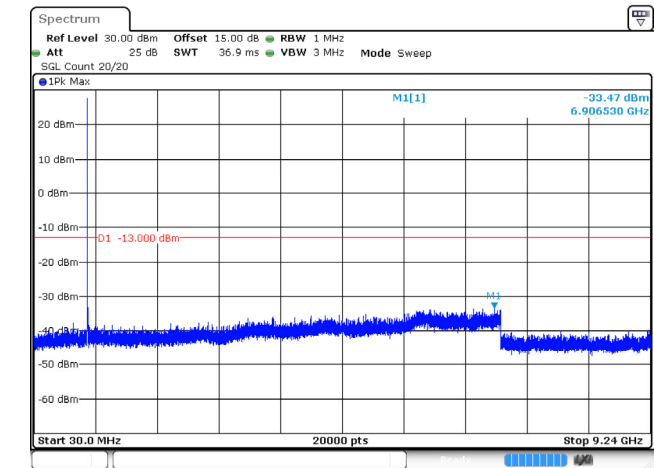


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:04:53

3MHz_Middle_QPSK_15@0(30MHz~9.24GHz)

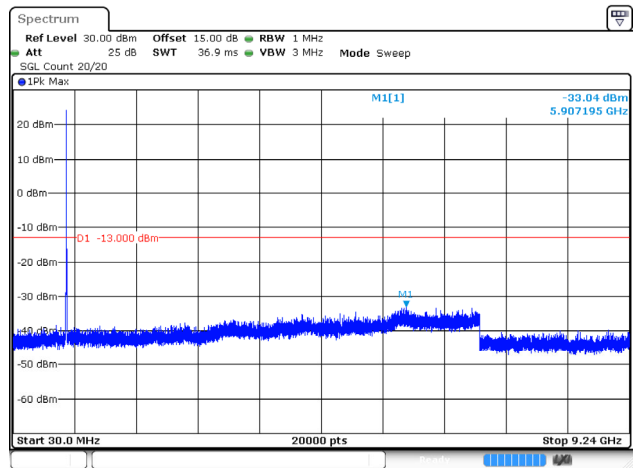


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:05:11

5MHz_Middle_QPSK_1@0(30MHz~9.24GHz)

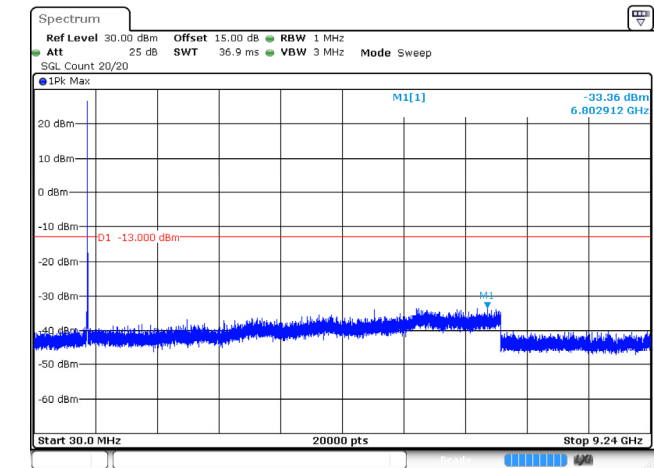


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:05:30

5MHz_Middle_QPSK_25@0(30MHz~9.24GHz)

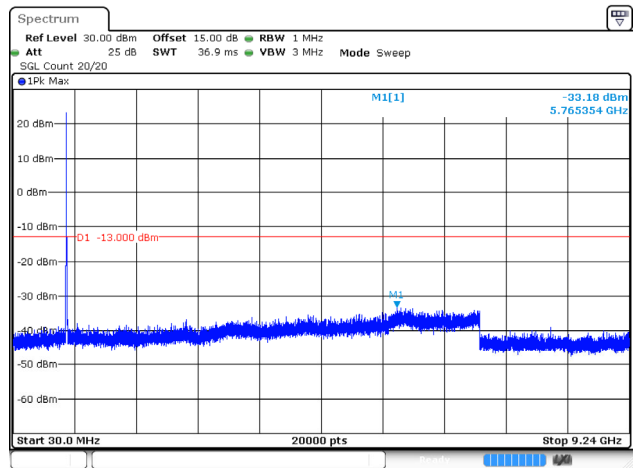


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:05:48

10MHz_Middle_QPSK_1@0(30MHz~9.24GHz)


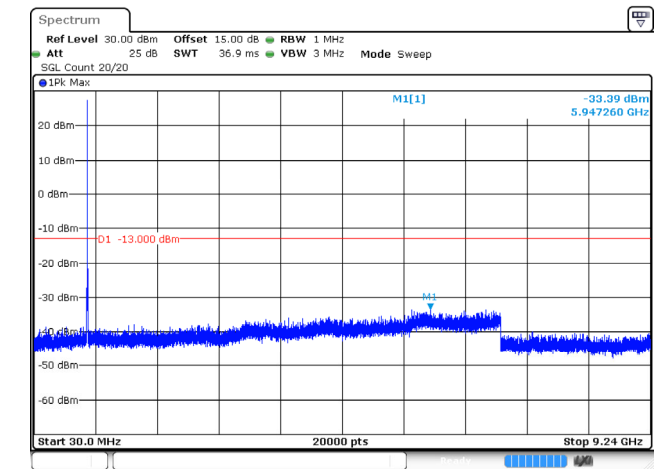


ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:06:08

10MHz_Middle_QPSK_50@0(30MHz~9.24GHz)

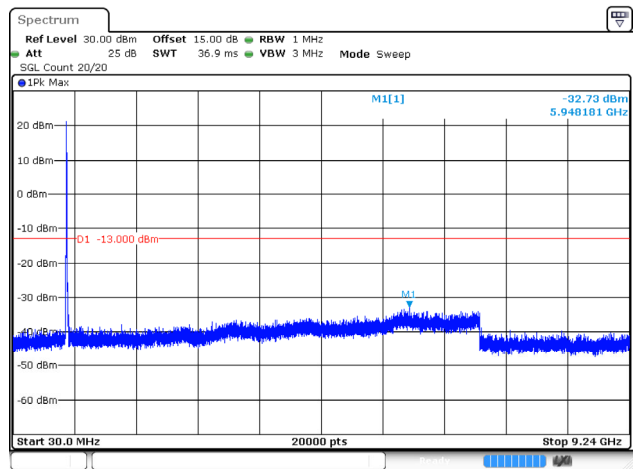

ProjectNo.:RKSA250707003 Tester:Jason Lu
Date: 21 JUL 2025 11:06:25

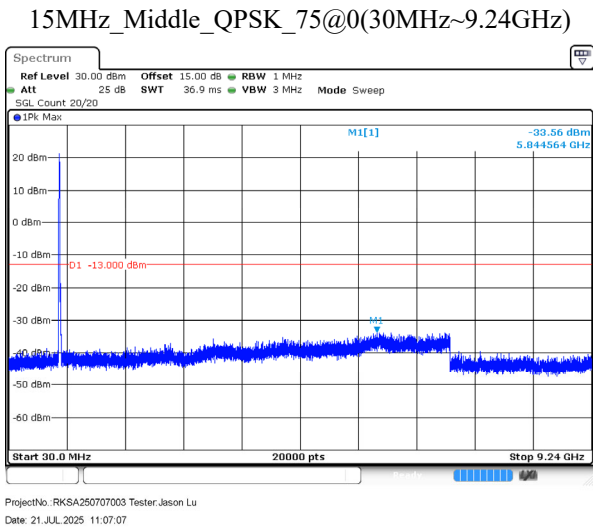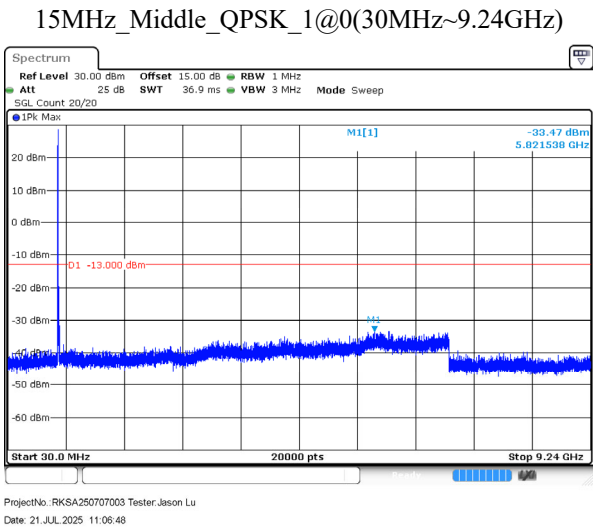

***** END *****