





Band Edge NVNT 2-DH5 2480MHz Ant1 No-Hopping Ref

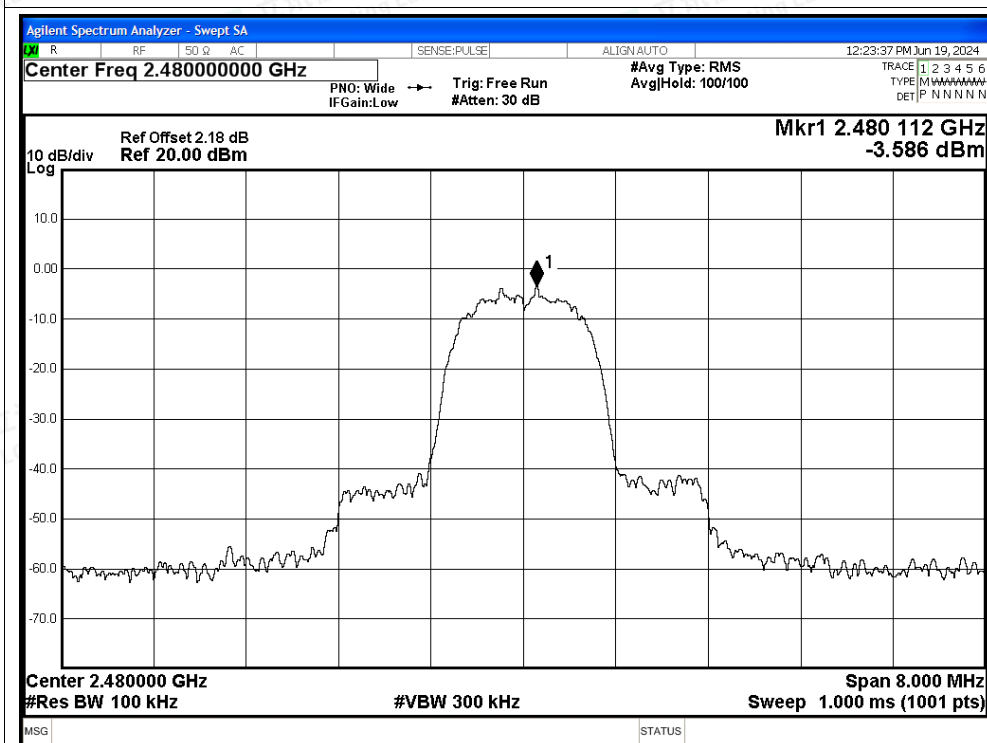

Band Edge NVNT 2-DH5 2480MHz Ant1 No-Hopping Emission

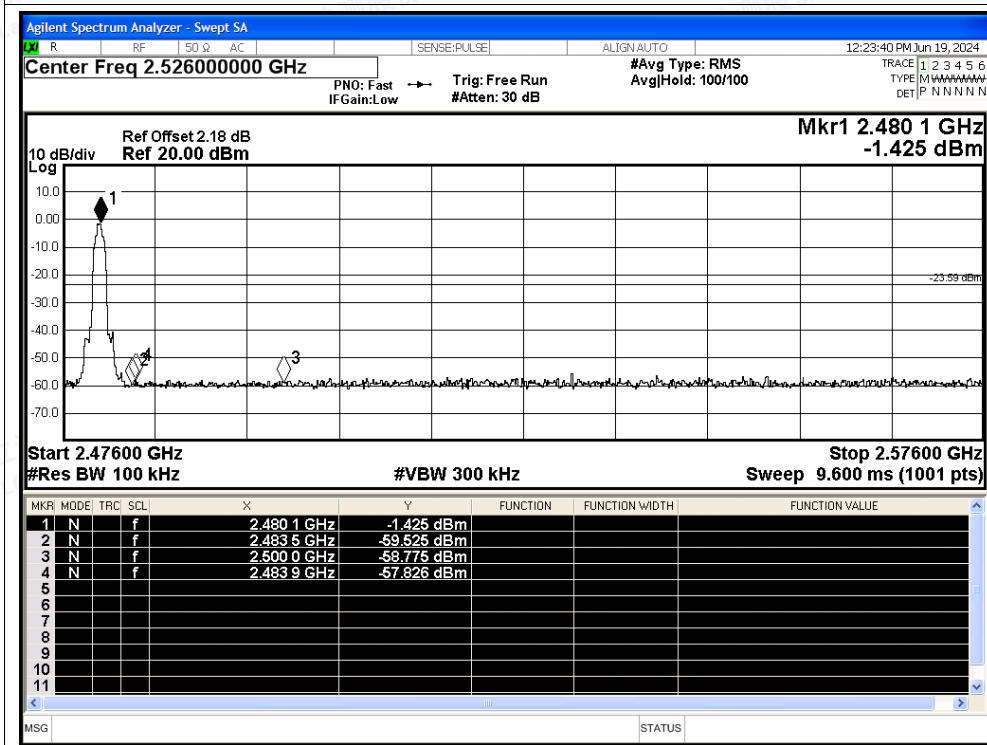

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge NVNT 3-DH5 2402MHz Ant1 No-Hopping Ref

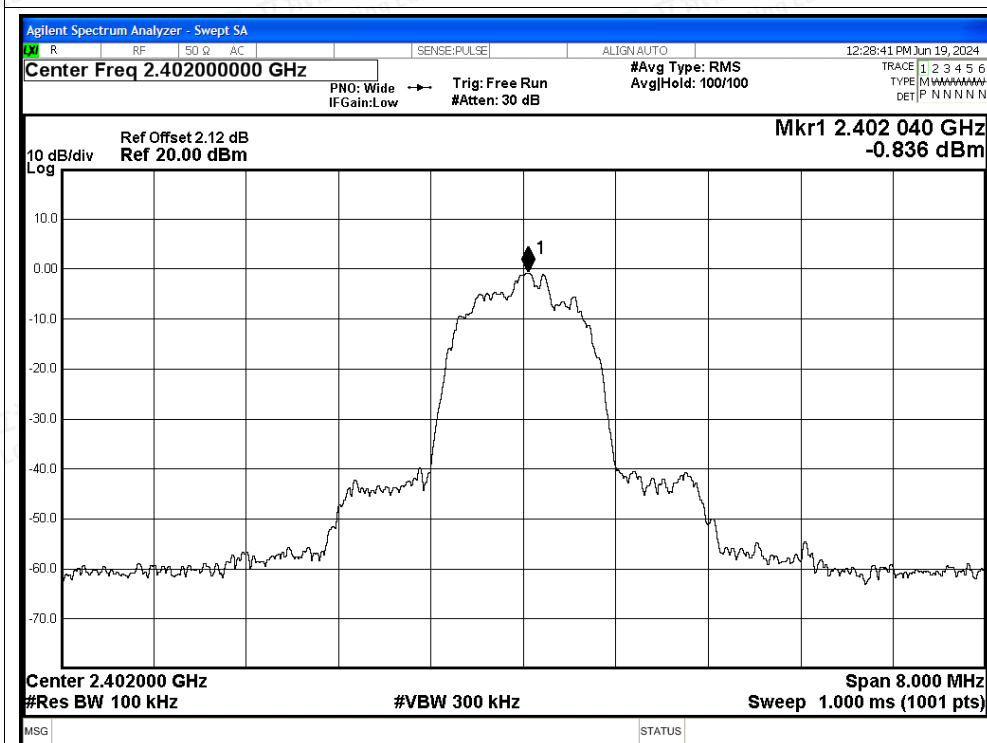

Band Edge NVNT 3-DH5 2402MHz Ant1 No-Hopping Emission

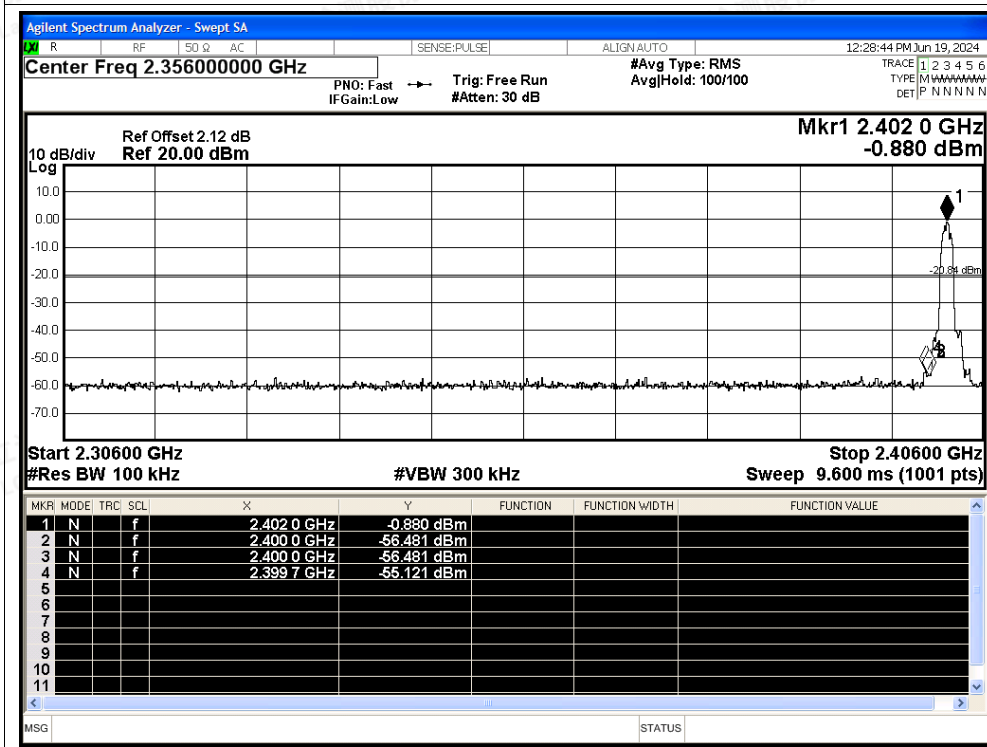

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge NVNT 3-DH5 2480MHz Ant1 No-Hopping Ref

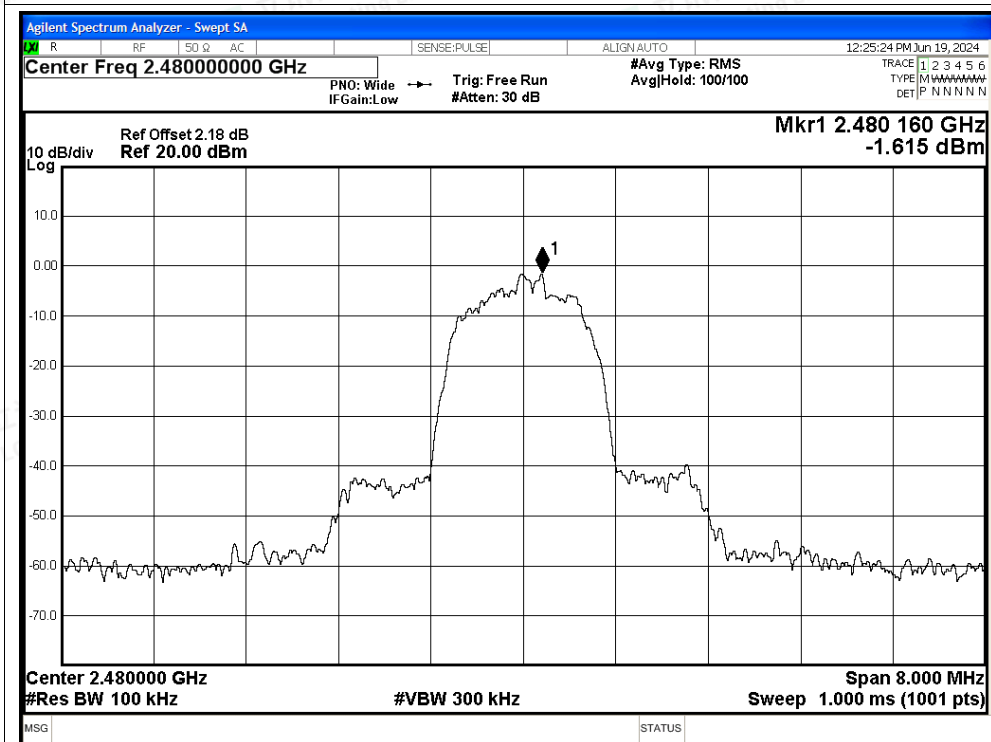

Band Edge NVNT 3-DH5 2480MHz Ant1 No-Hopping Emission

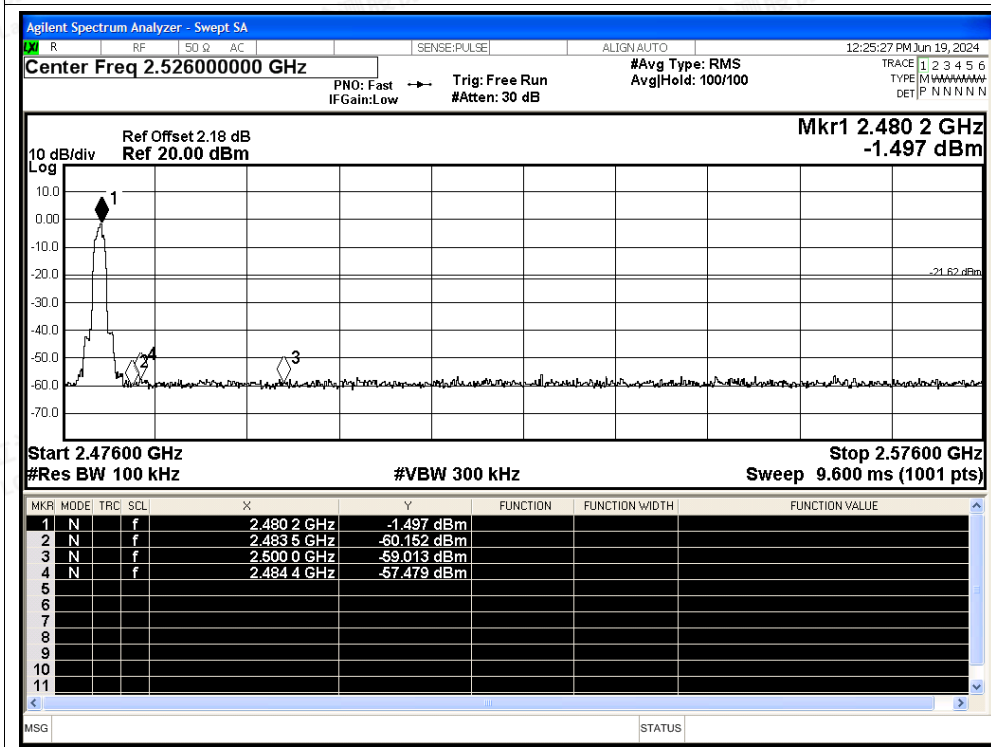

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



(Hopping)


Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	Hopping	-55.48	-20	Pass
NVNT	1-DH5	2480	Ant1	Hopping	-57.01	-20	Pass
NVNT	2-DH5	2402	Ant1	Hopping	-54.39	-20	Pass
NVNT	2-DH5	2480	Ant1	Hopping	-55.78	-20	Pass
NVNT	3-DH5	2402	Ant1	Hopping	-53.31	-20	Pass
NVNT	3-DH5	2480	Ant1	Hopping	-53.7	-20	Pass






Test Graphs

Band Edge(Hopping) NVNT 1-DH5 2402MHz Ant1 Hopping Ref

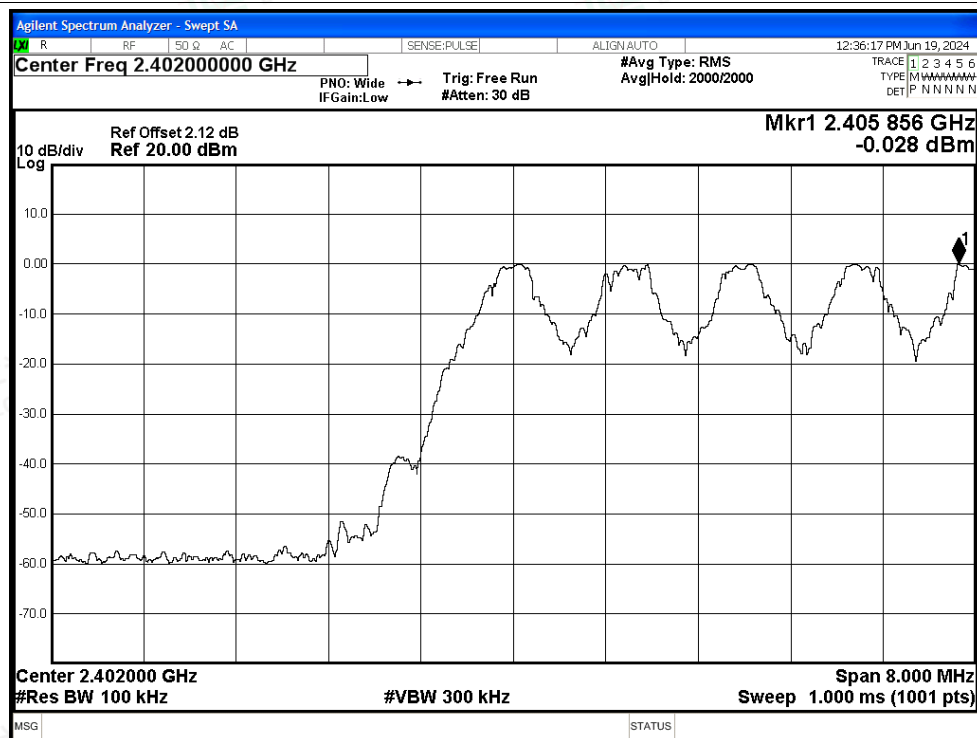

Band Edge(Hopping) NVNT 1-DH5 2402MHz Ant1 Hopping Emission

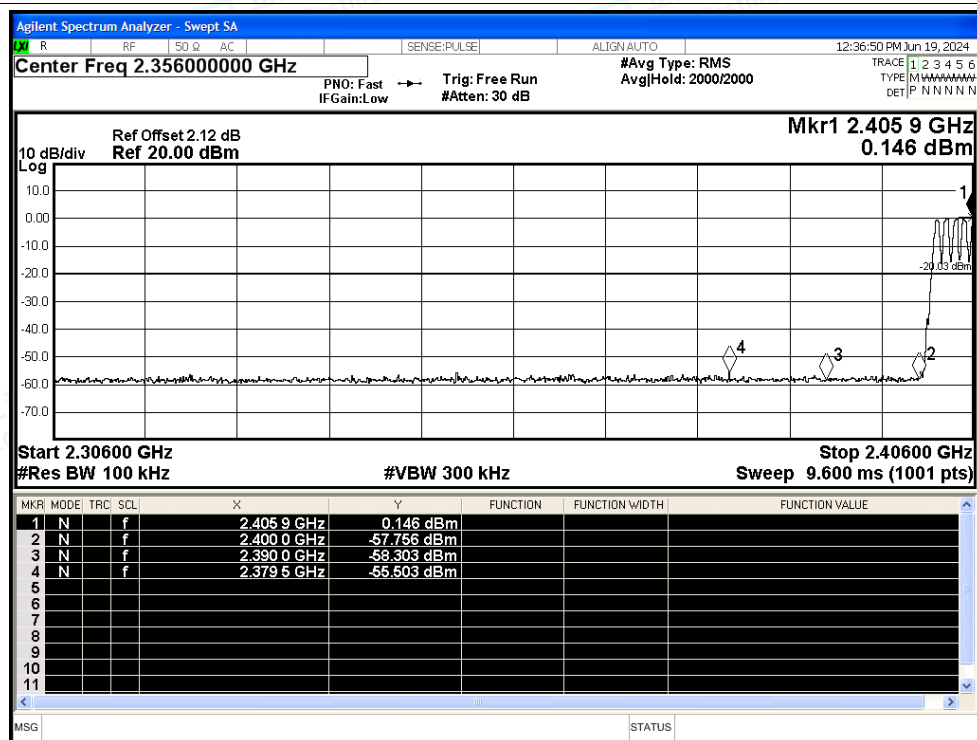

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 1-DH5 2480MHz Ant1 Hopping Ref

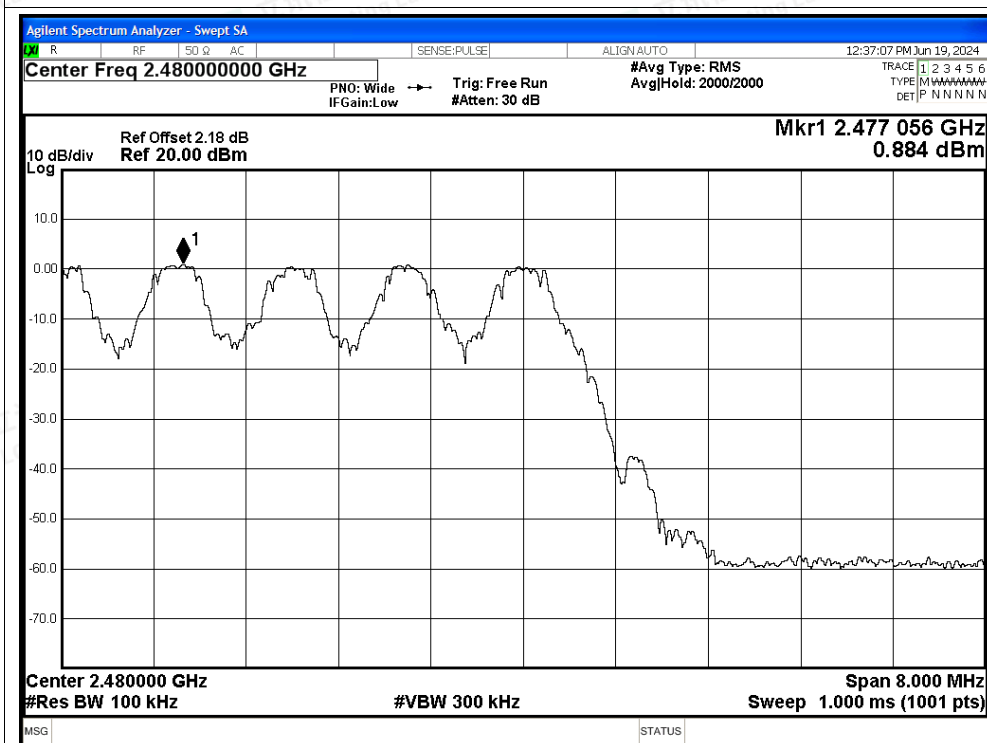

Band Edge(Hopping) NVNT 1-DH5 2480MHz Ant1 Hopping Emission

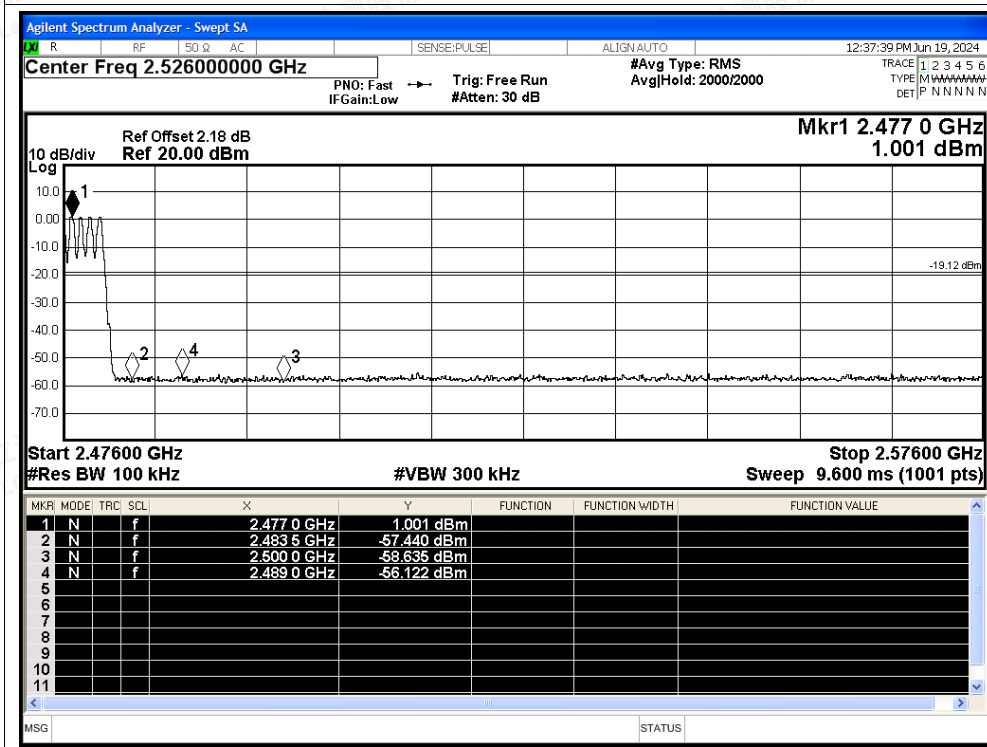

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 2-DH5 2402MHz Ant1 Hopping Ref



Band Edge(Hopping) NVNT 2-DH5 2402MHz Ant1 Hopping Emission

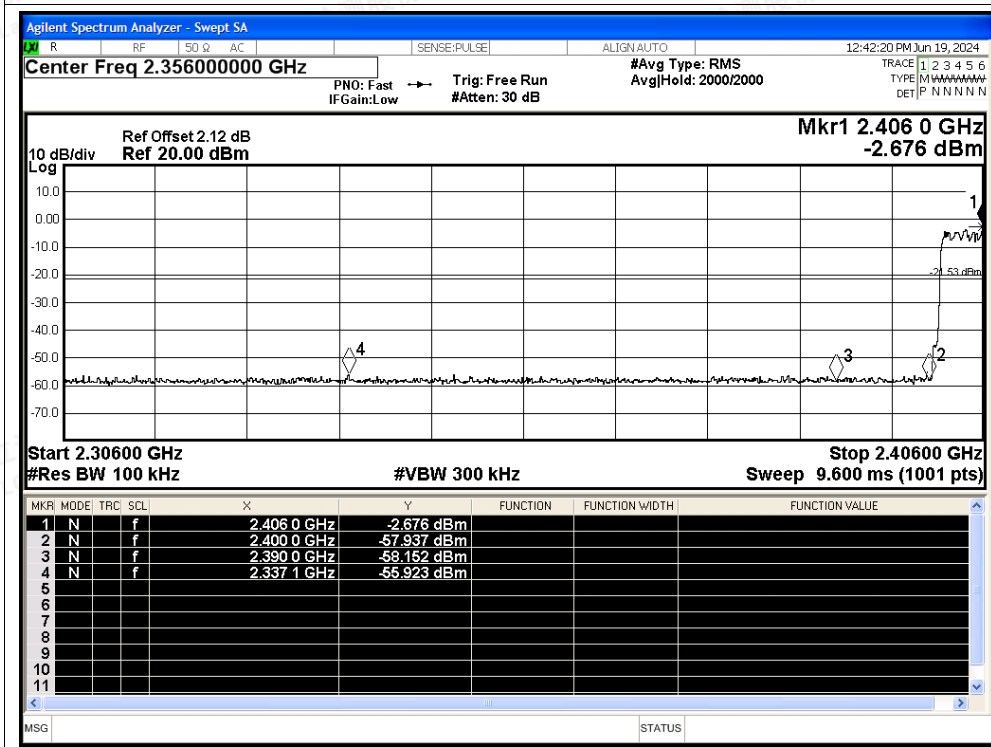

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 2-DH5 2480MHz Ant1 Hopping Ref

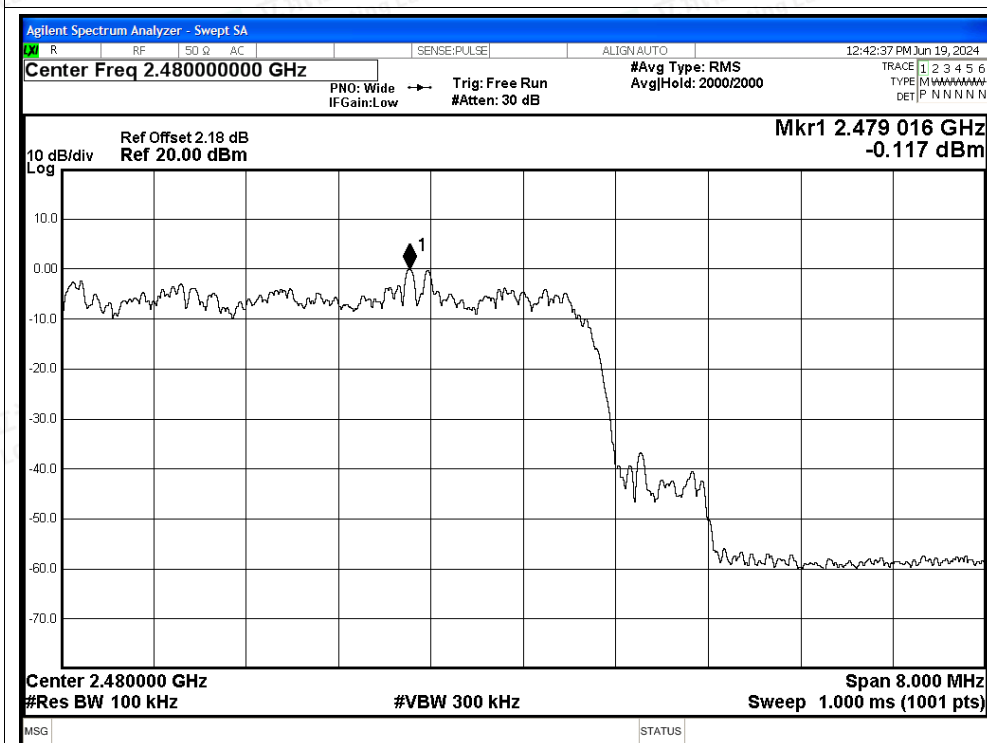

Band Edge(Hopping) NVNT 2-DH5 2480MHz Ant1 Hopping Emission

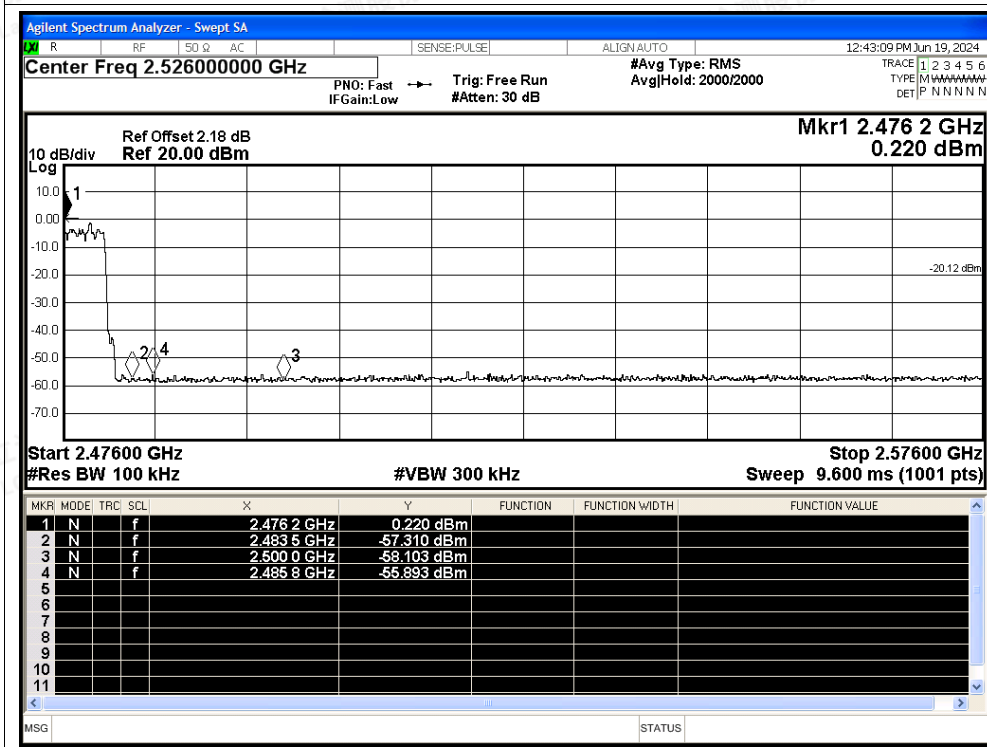

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 3-DH5 2402MHz Ant1 Hopping Ref

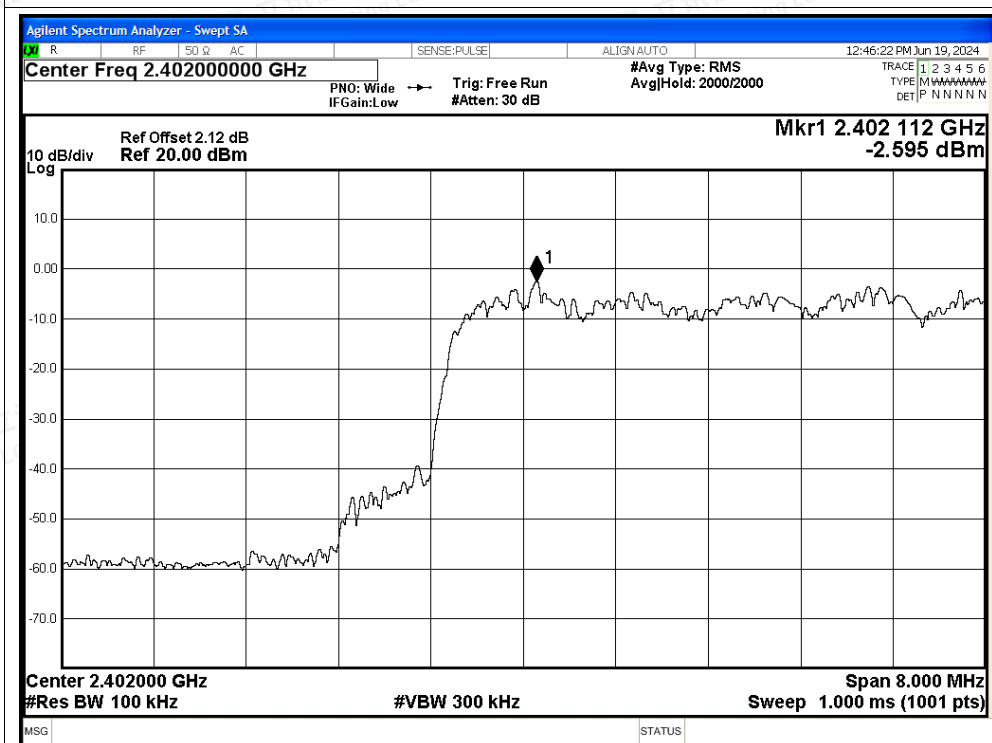

Band Edge(Hopping) NVNT 3-DH5 2402MHz Ant1 Hopping Emission

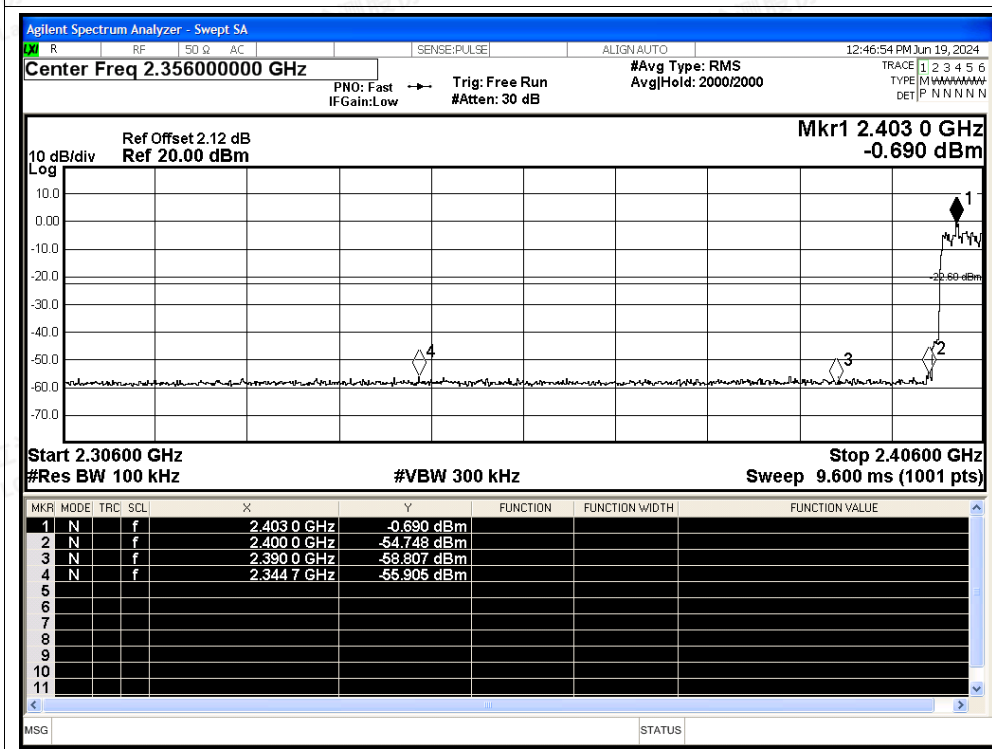

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Band Edge(Hopping) NVNT 3-DH5 2480MHz Ant1 Hopping Ref

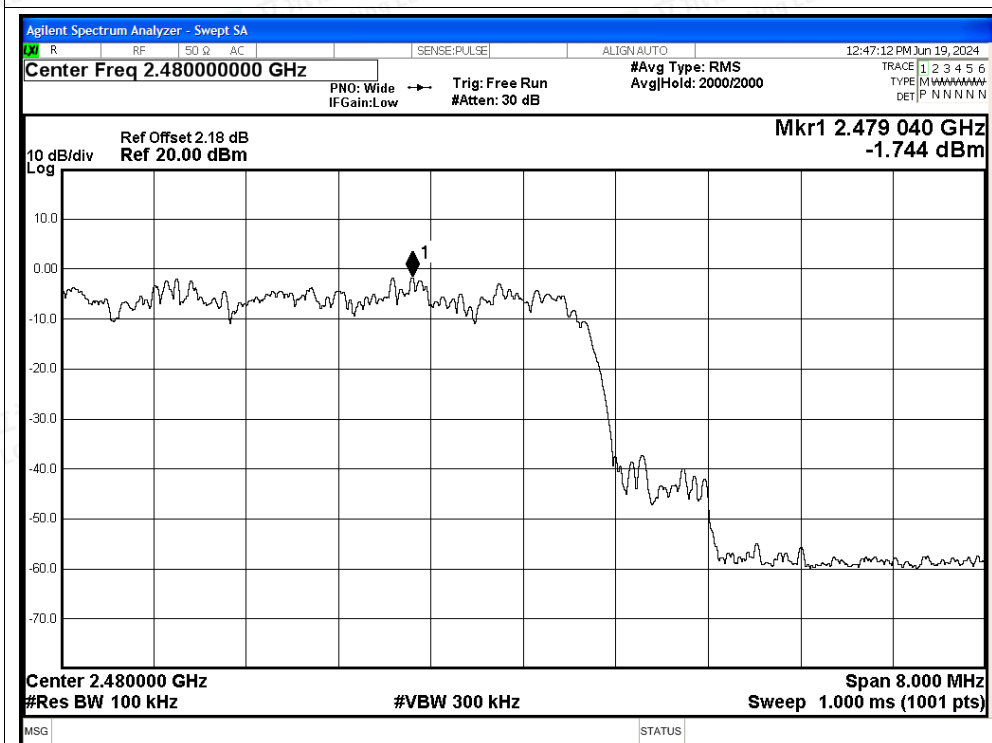

Band Edge(Hopping) NVNT 3-DH5 2480MHz Ant1 Hopping Emission

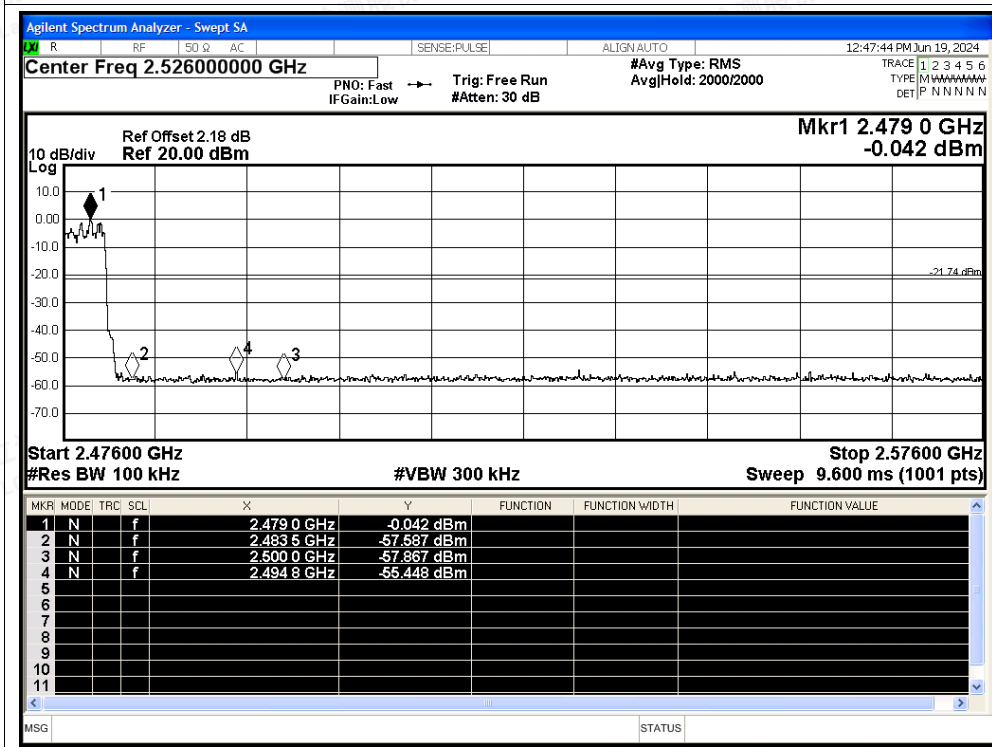

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.7 Conducted RF Spurious Emission

Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	1-DH5	2402	Ant1	-55.21	-20	Pass
NVNT	1-DH5	2441	Ant1	-54.67	-20	Pass
NVNT	1-DH5	2480	Ant1	-54.39	-20	Pass
NVNT	2-DH5	2402	Ant1	-54.67	-20	Pass
NVNT	2-DH5	2441	Ant1	-53.24	-20	Pass
NVNT	2-DH5	2480	Ant1	-53.85	-20	Pass
NVNT	3-DH5	2402	Ant1	-53	-20	Pass
NVNT	3-DH5	2441	Ant1	-53.75	-20	Pass
NVNT	3-DH5	2480	Ant1	-54.05	-20	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Ref

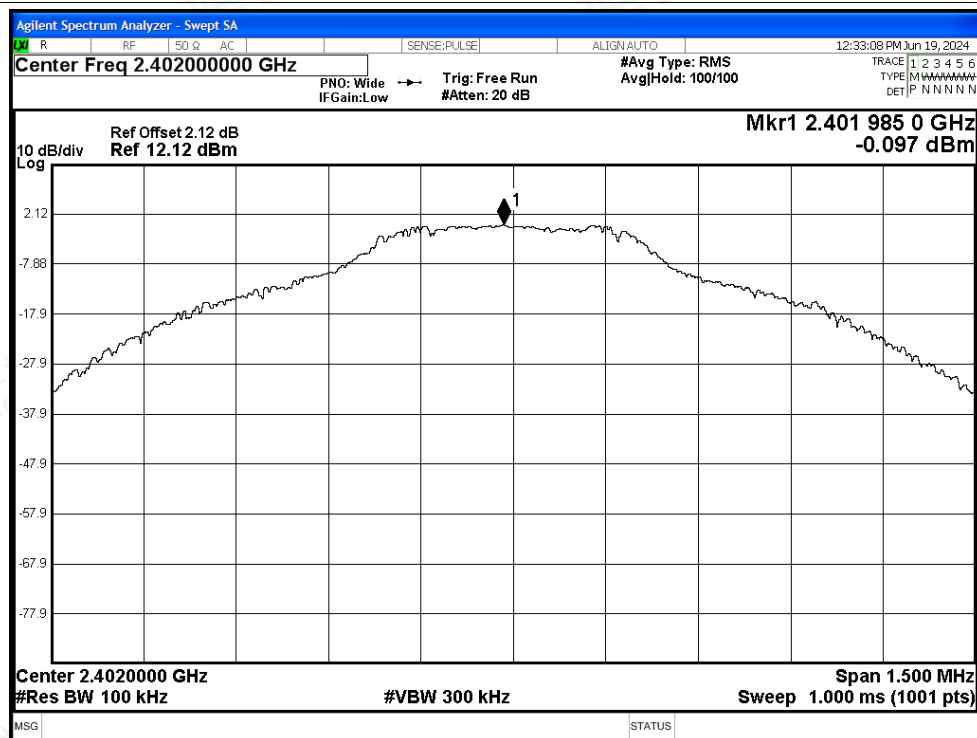

Tx. Spurious NVNT 1-DH5 2402MHz Ant1 Emission

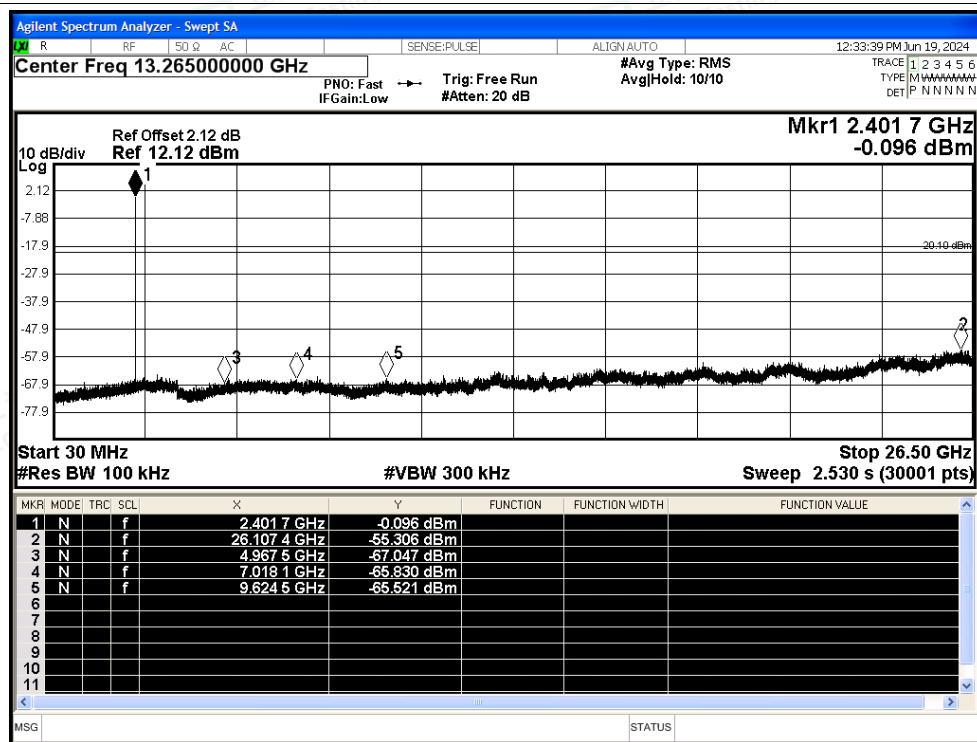

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Ref

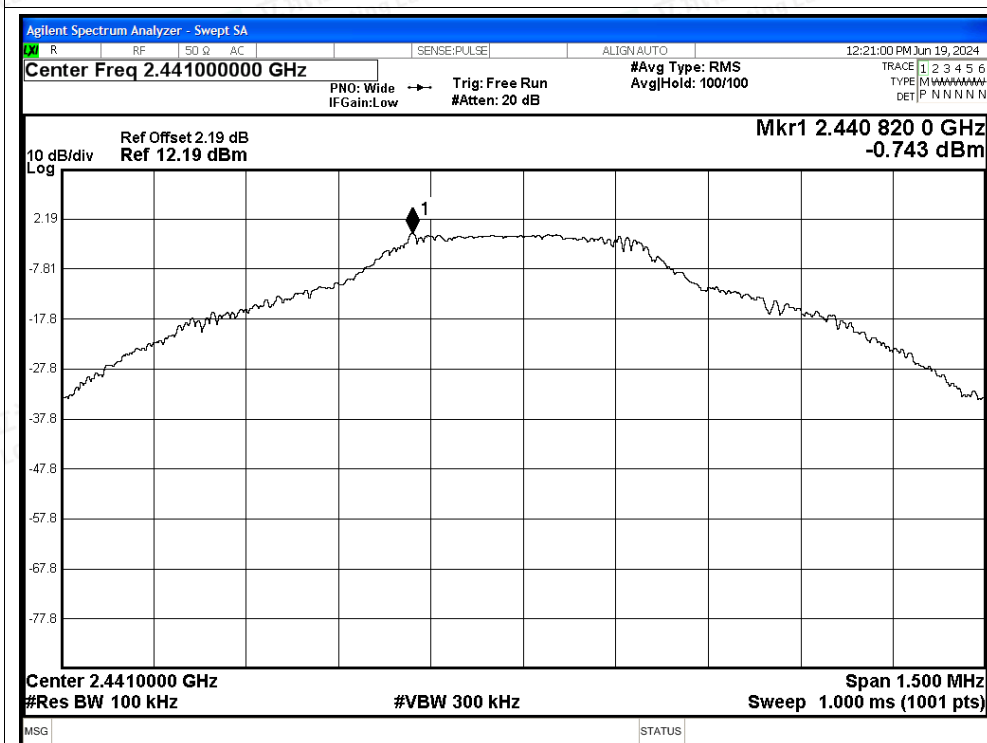

Tx. Spurious NVNT 1-DH5 2441MHz Ant1 Emission

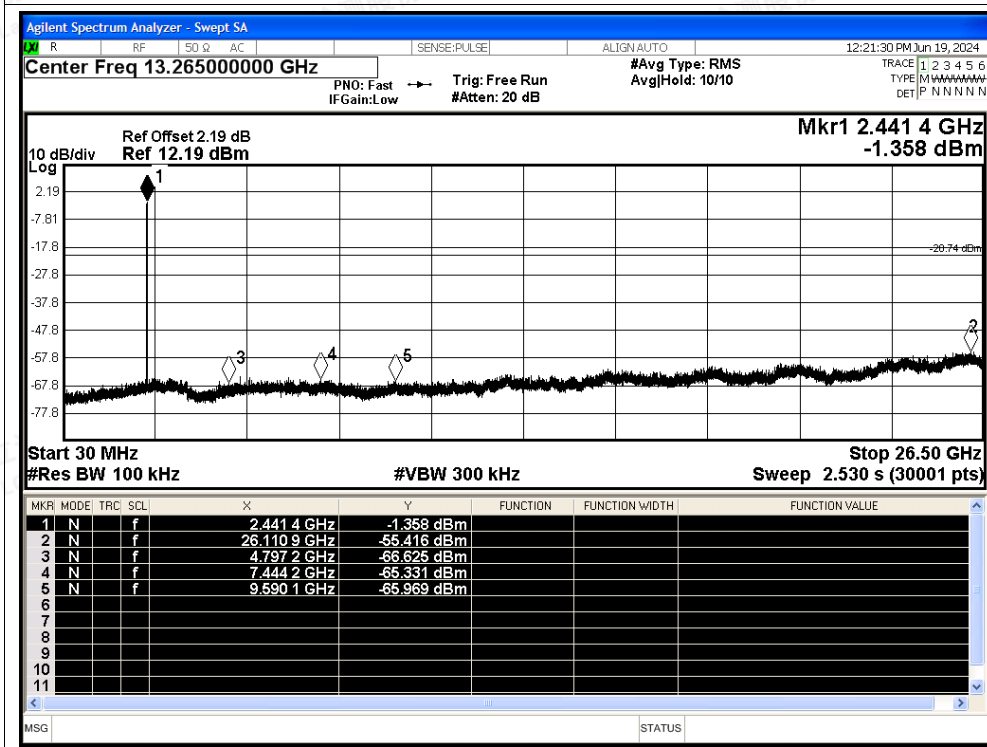

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Ref

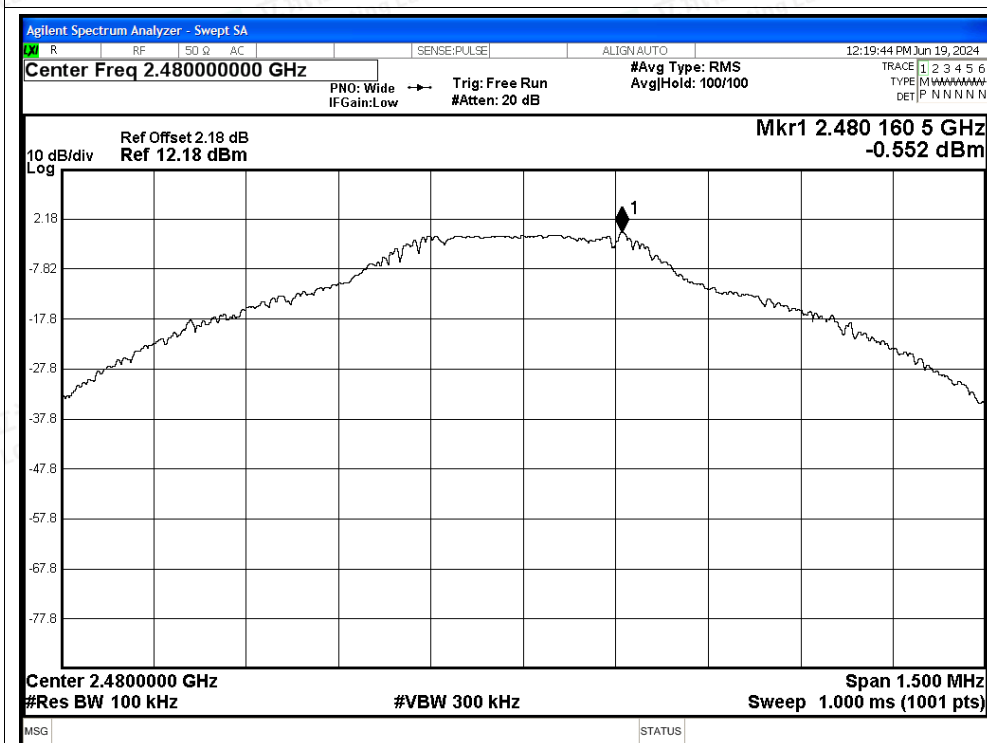

Tx. Spurious NVNT 1-DH5 2480MHz Ant1 Emission

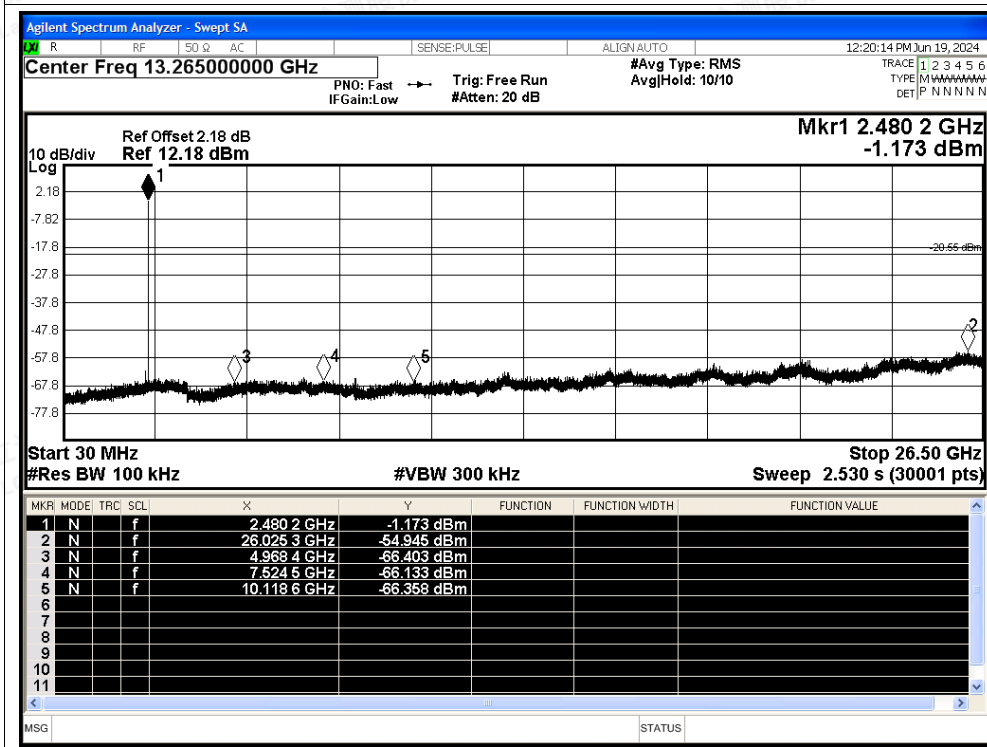

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Ref

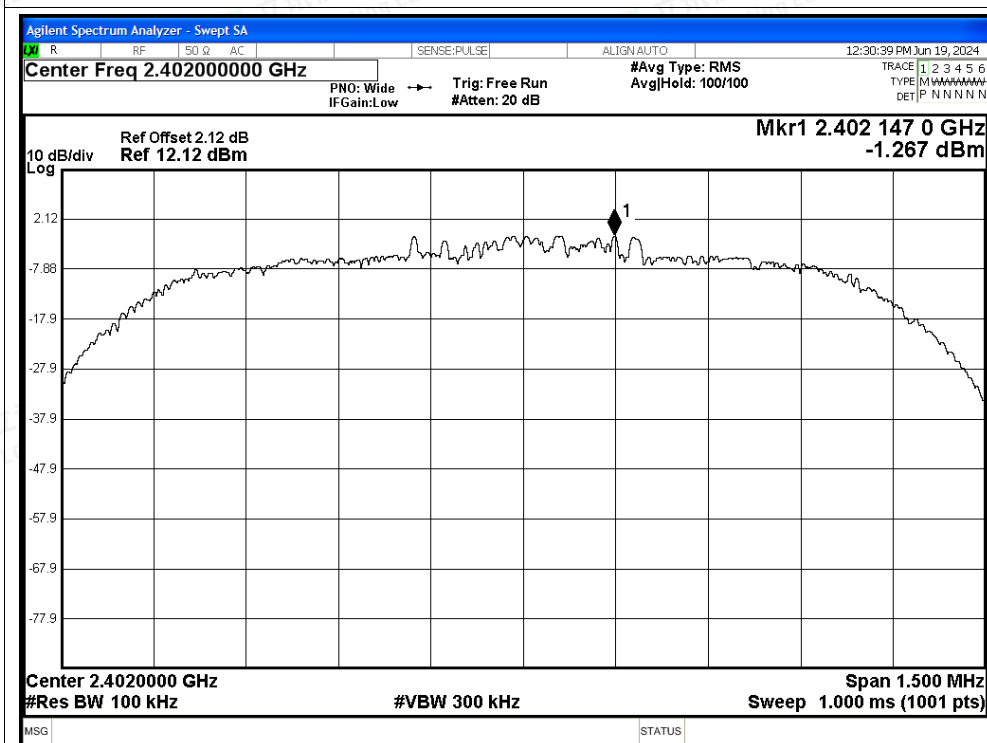

Tx. Spurious NVNT 2-DH5 2402MHz Ant1 Emission

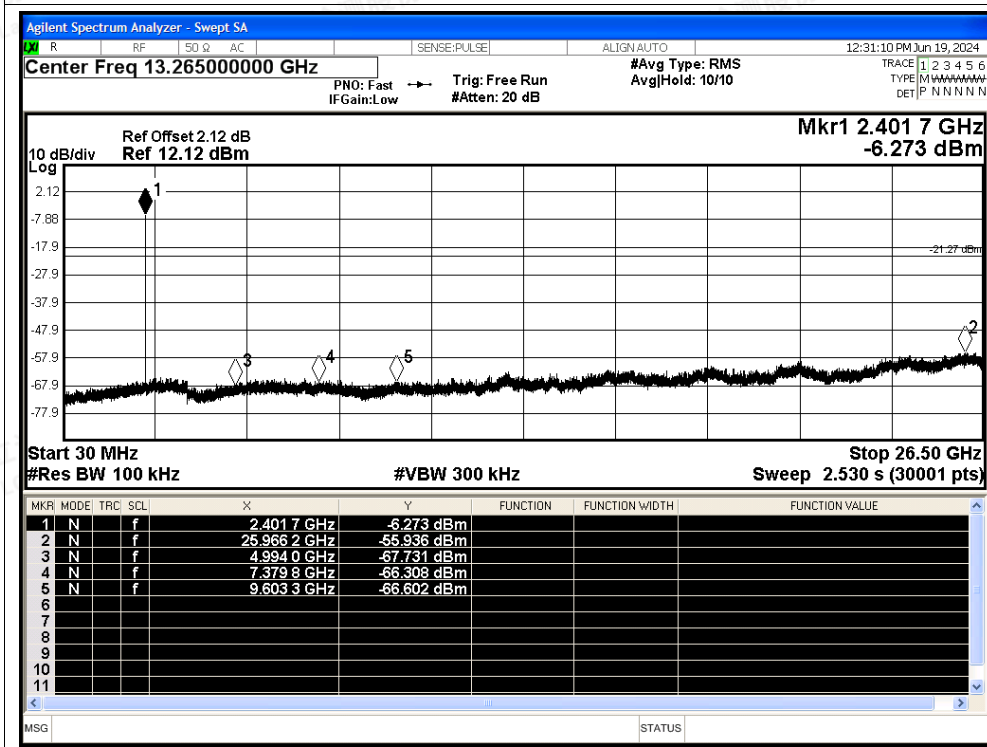

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Ref

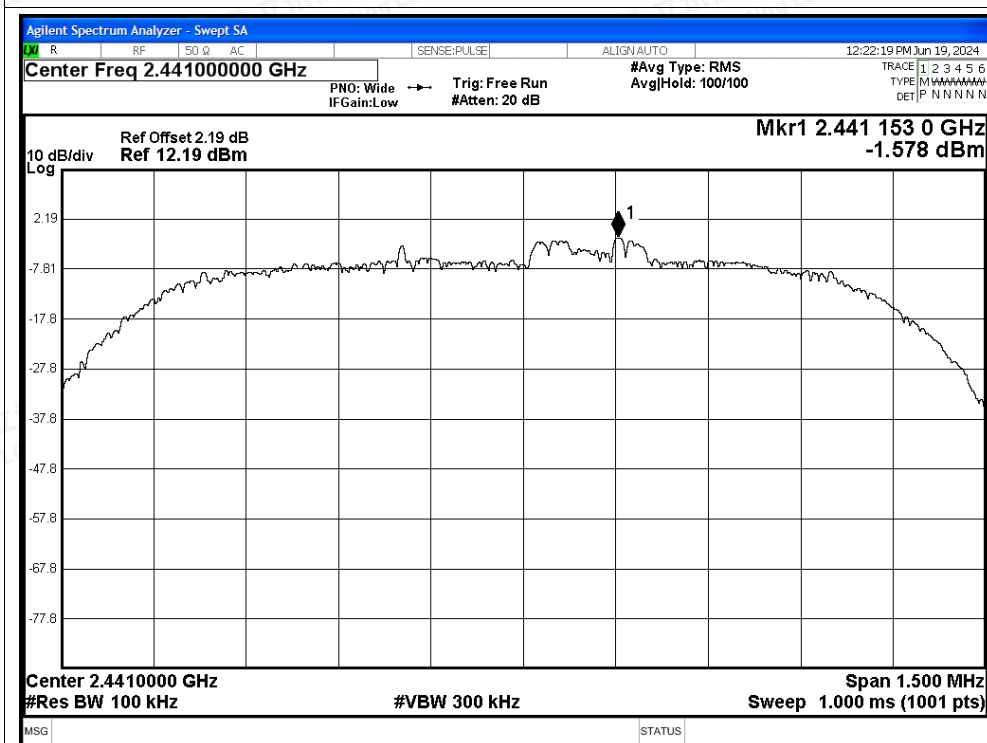

Tx. Spurious NVNT 2-DH5 2441MHz Ant1 Emission

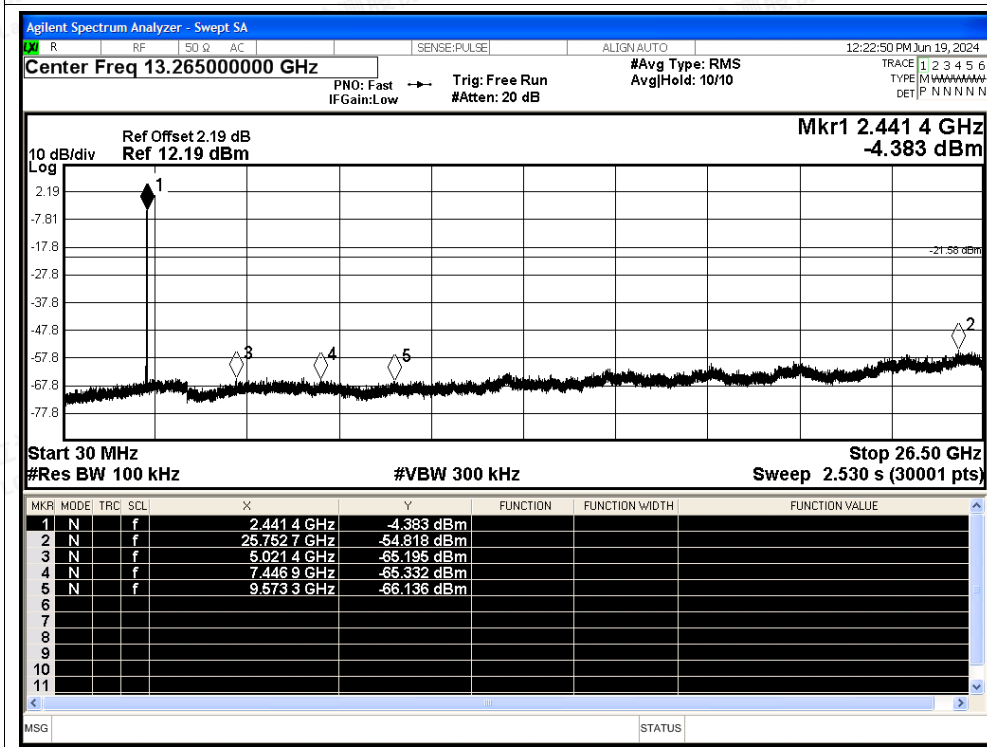

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Ref

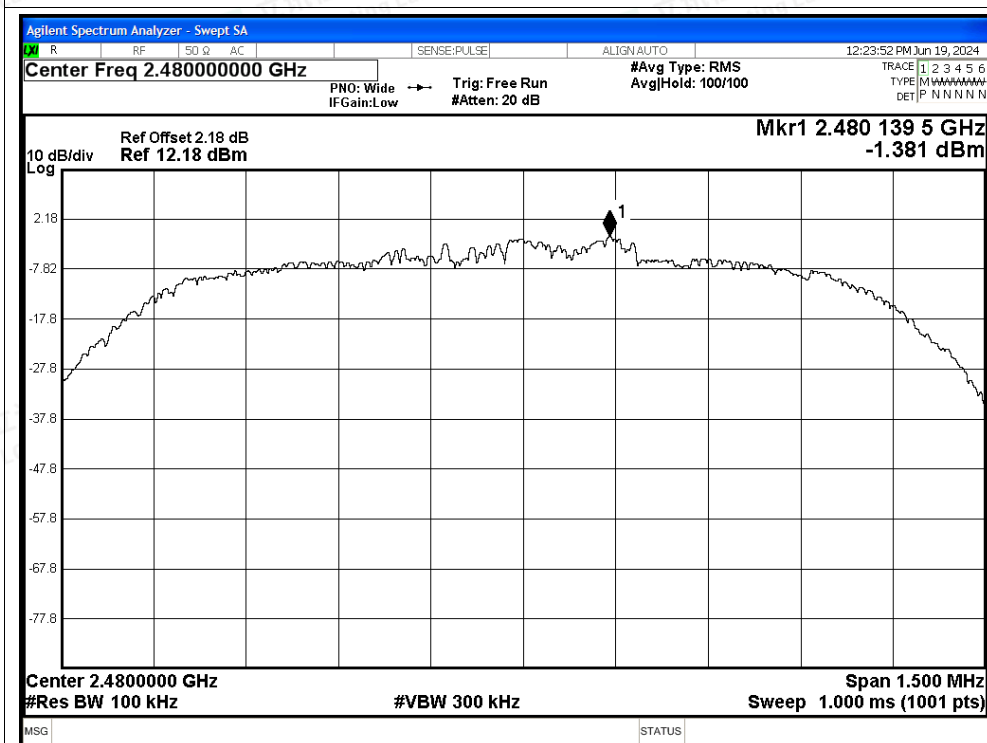

Tx. Spurious NVNT 2-DH5 2480MHz Ant1 Emission

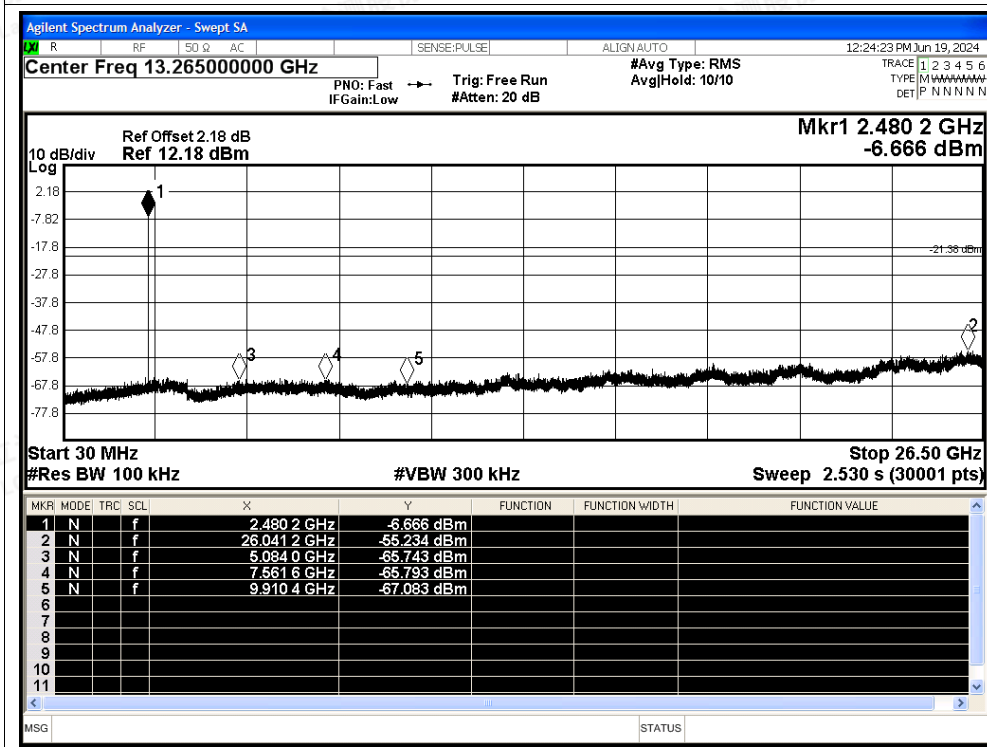

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Ref

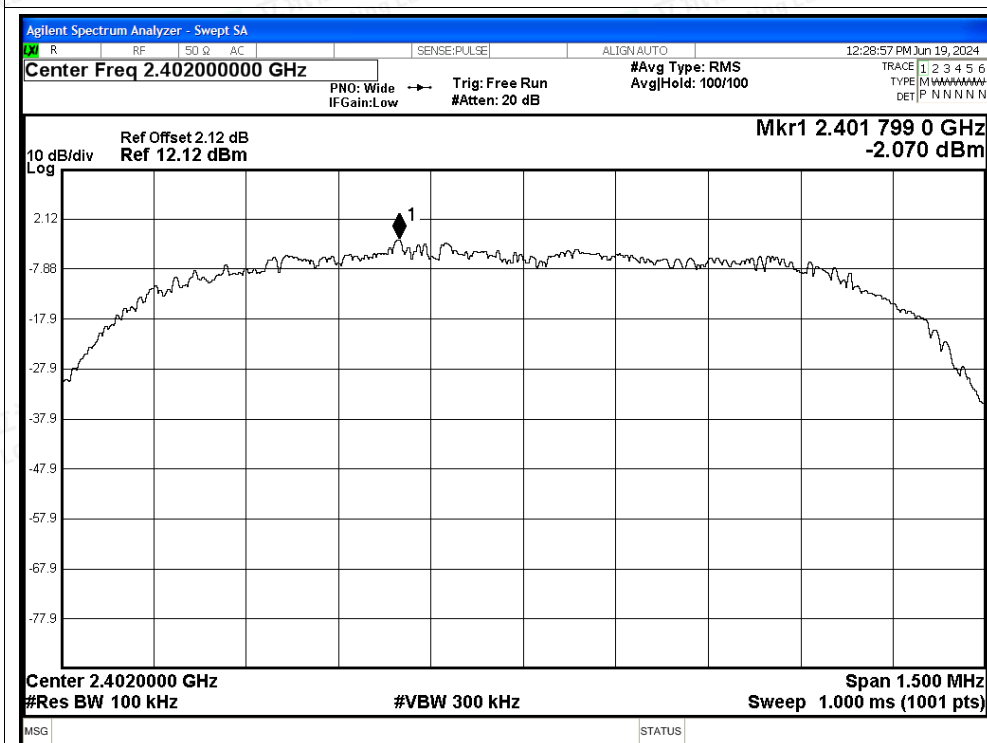

Tx. Spurious NVNT 3-DH5 2402MHz Ant1 Emission

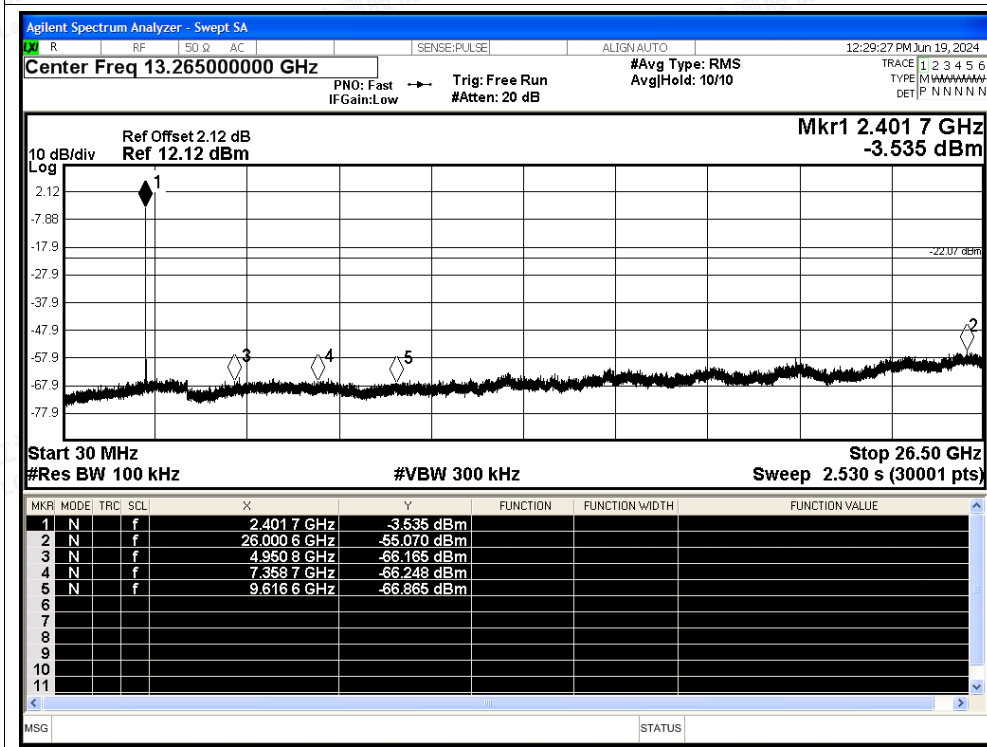

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Ref

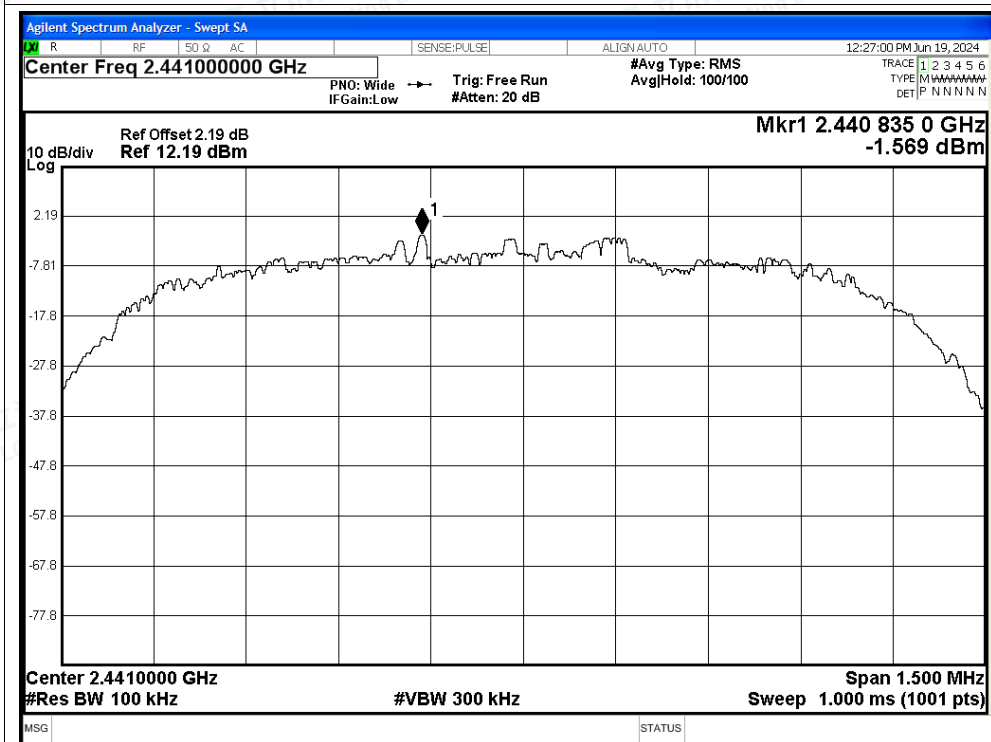

Tx. Spurious NVNT 3-DH5 2441MHz Ant1 Emission

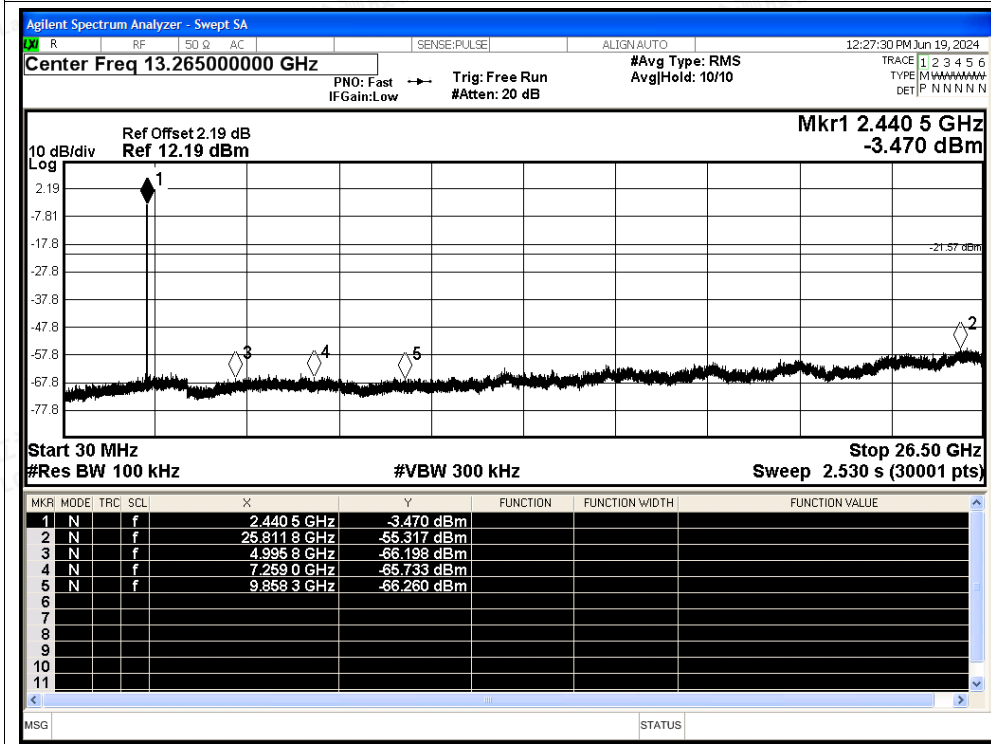

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Ref

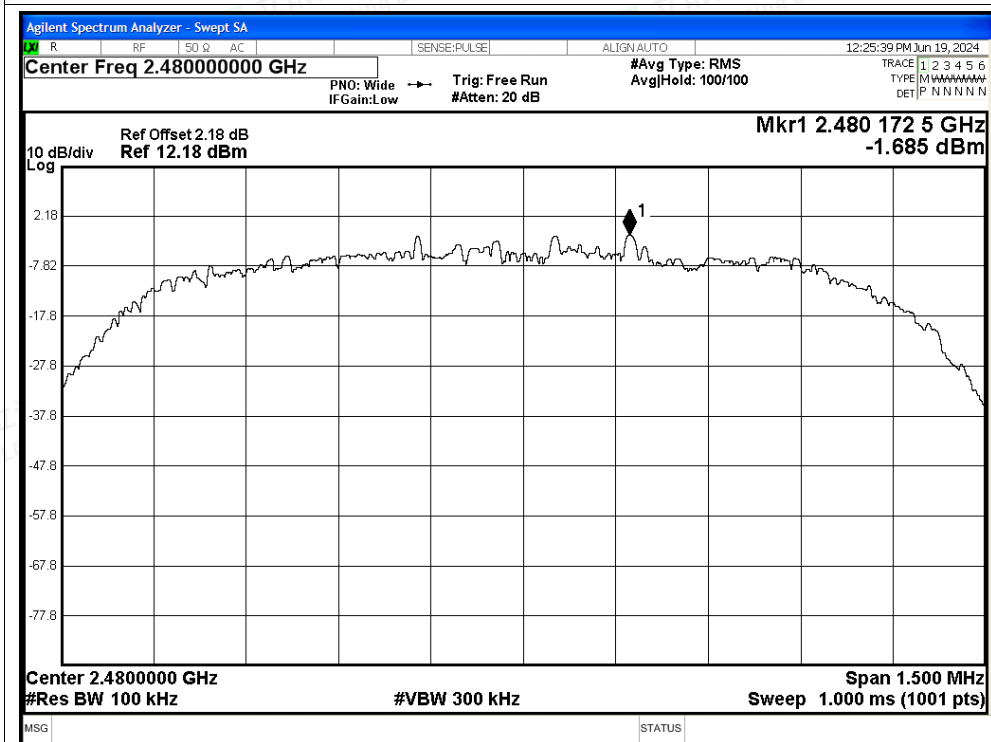

Tx. Spurious NVNT 3-DH5 2480MHz Ant1 Emission

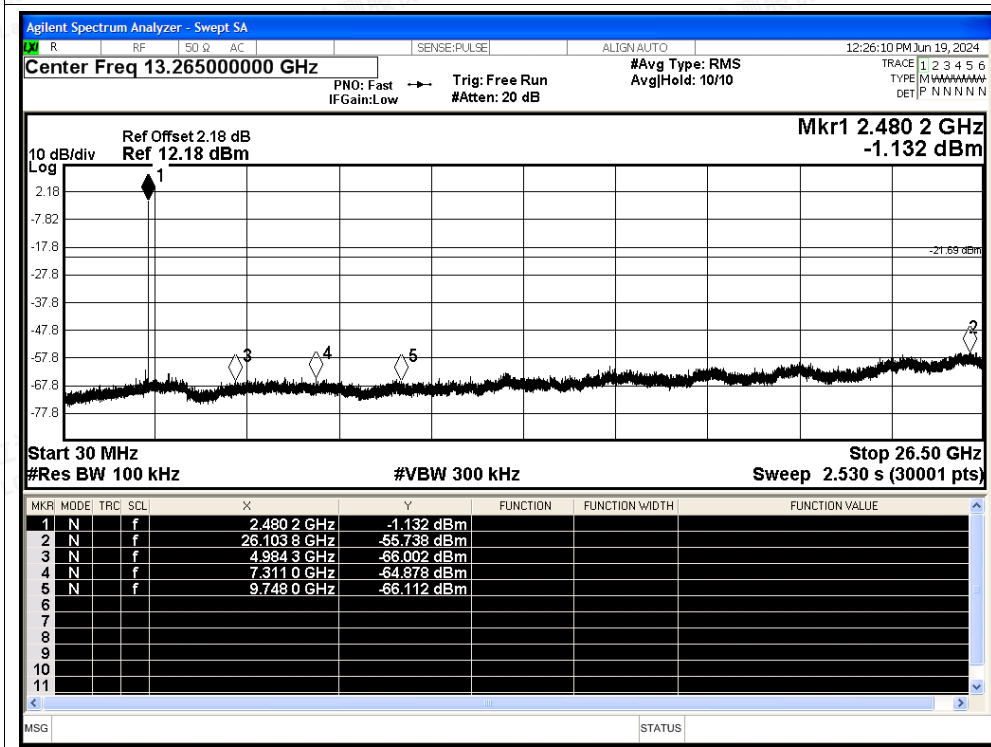

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.8 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	1-DH5	2402	Ant1	76.88	1.14	0.35
NVNT	1-DH5	2441	Ant1	76.88	1.14	0.35
NVNT	1-DH5	2480	Ant1	76.88	1.14	0.35
NVNT	2-DH5	2402	Ant1	76.99	1.14	0.35
NVNT	2-DH5	2441	Ant1	76.96	1.14	0.35
NVNT	2-DH5	2480	Ant1	76.99	1.14	0.35
NVNT	3-DH5	2402	Ant1	77.01	1.13	0.35
NVNT	3-DH5	2441	Ant1	77.04	1.13	0.35
NVNT	3-DH5	2480	Ant1	77.02	1.13	0.35




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Duty Cycle NVNT 1-DH5 2402MHz Ant1

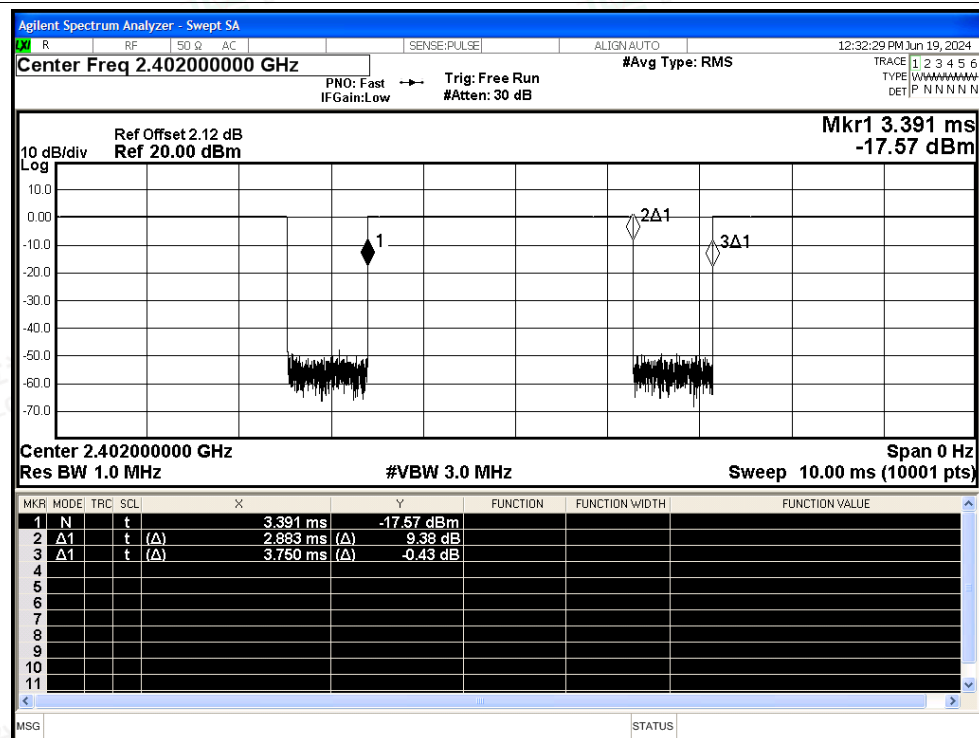

Duty Cycle NVNT 1-DH5 2441MHz Ant1

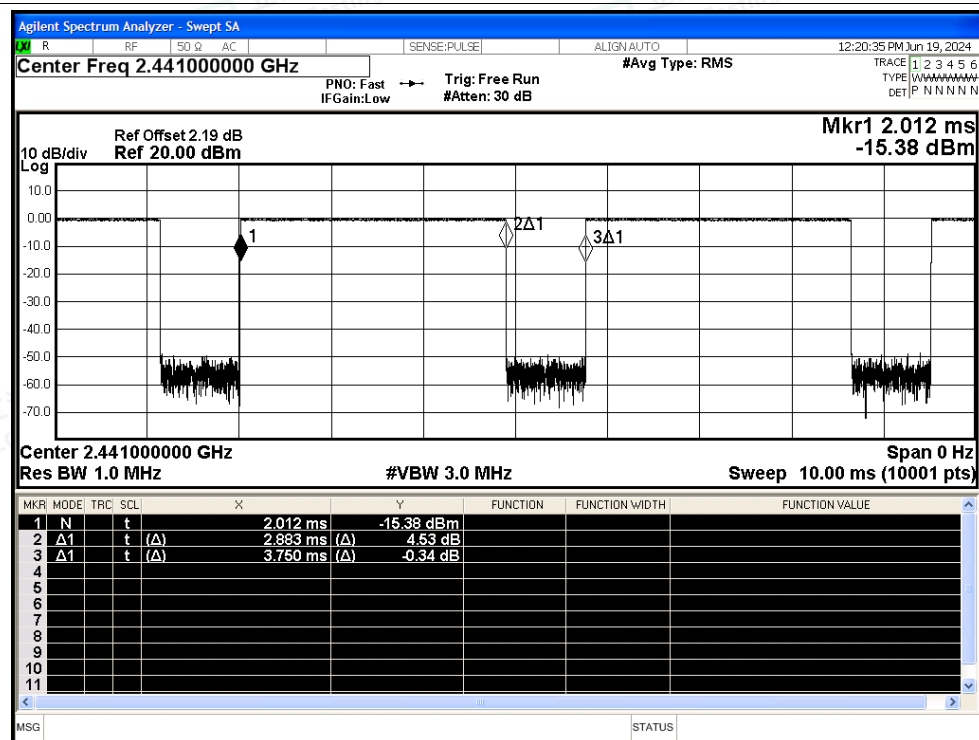

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 1-DH5 2480MHz Ant1

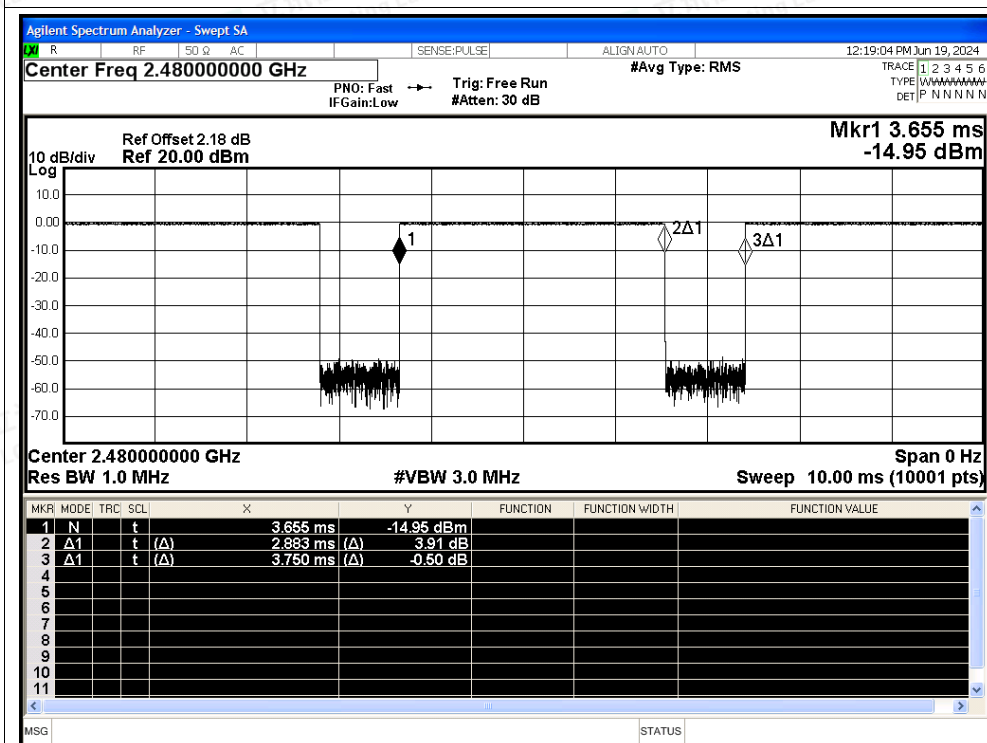

Duty Cycle NVNT 2-DH5 2402MHz Ant1

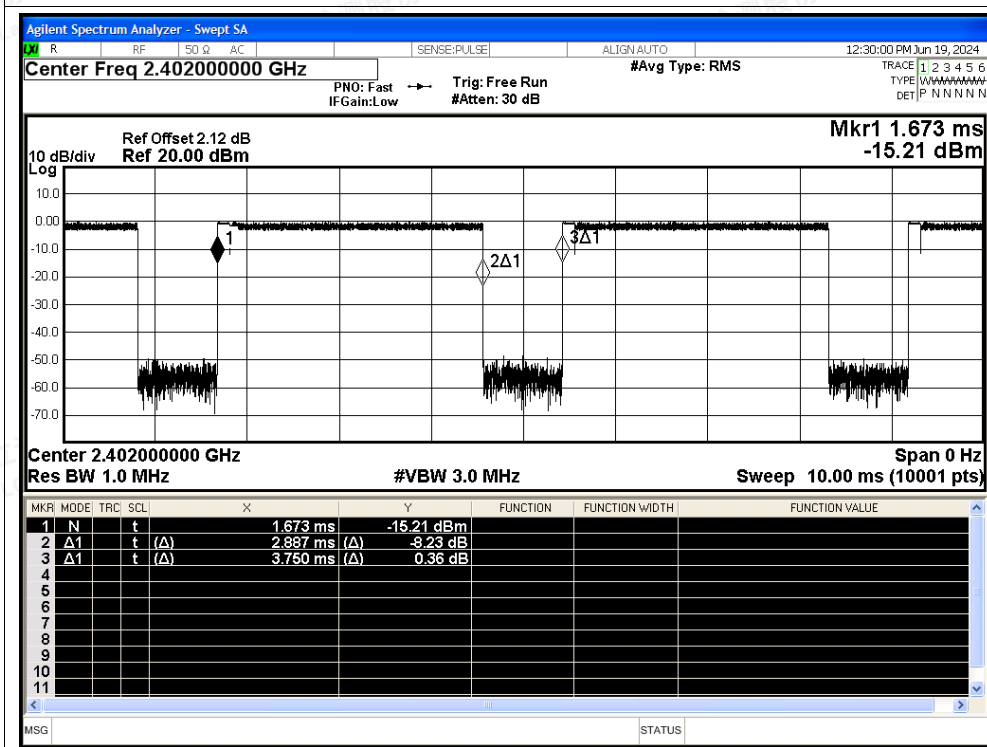

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 2-DH5 2441MHz Ant1

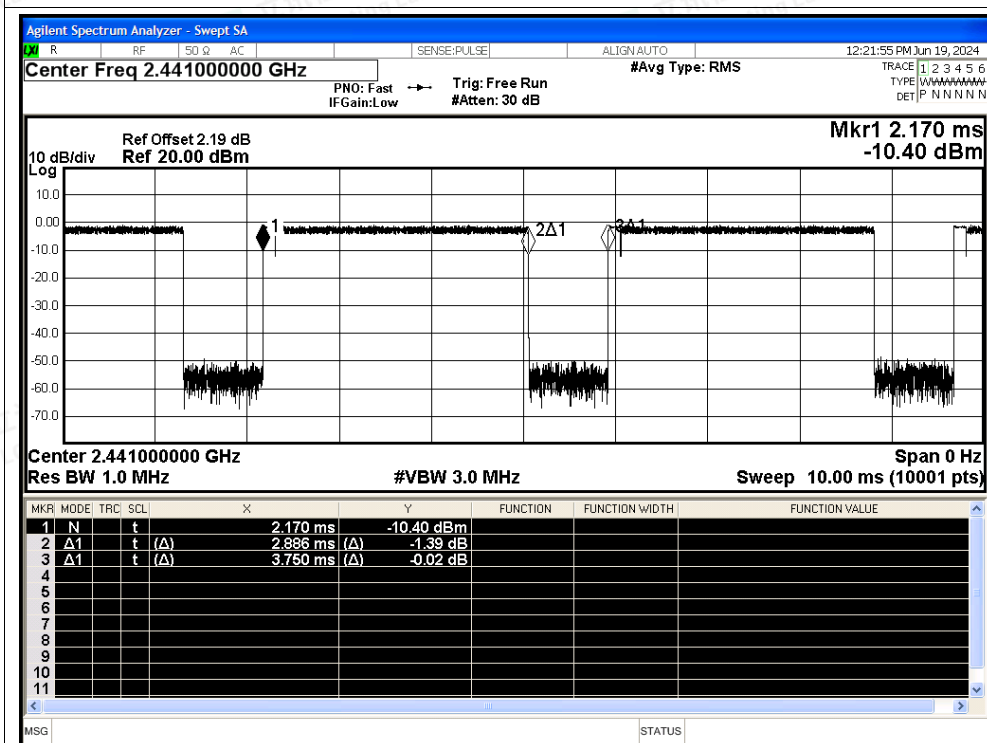

Duty Cycle NVNT 2-DH5 2480MHz Ant1

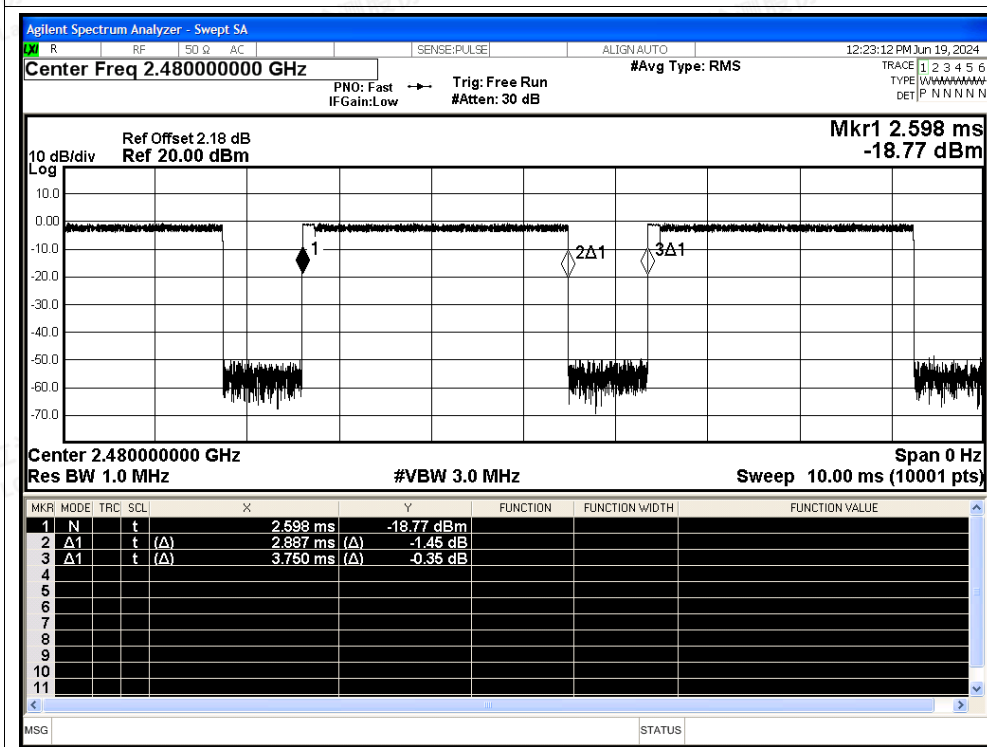

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT 3-DH5 2402MHz Ant1

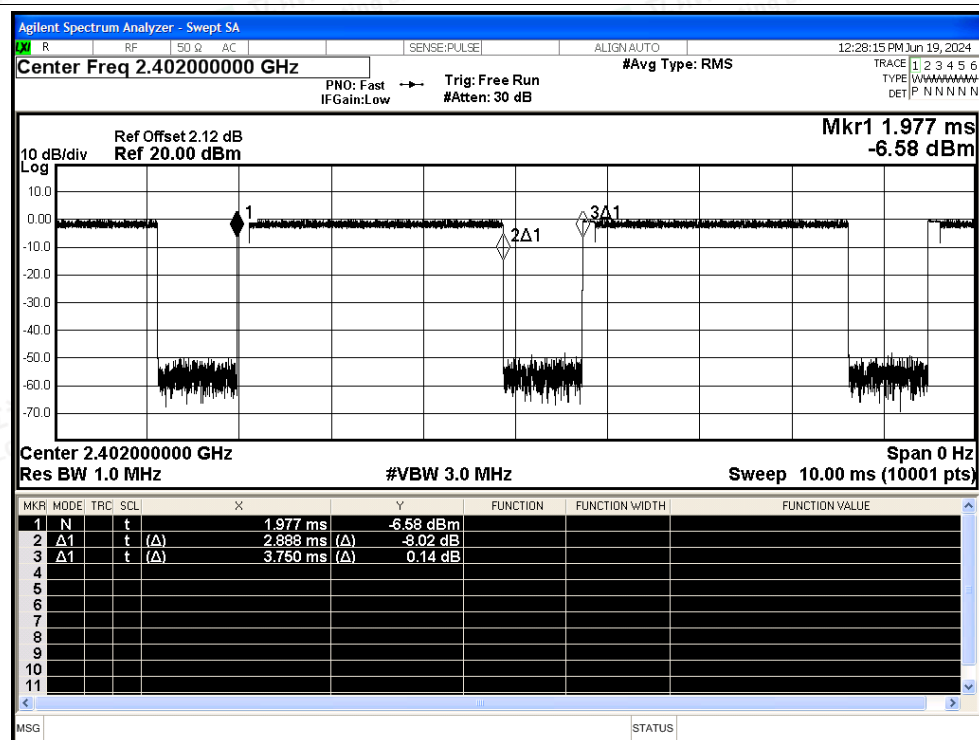

Duty Cycle NVNT 3-DH5 2441MHz Ant1

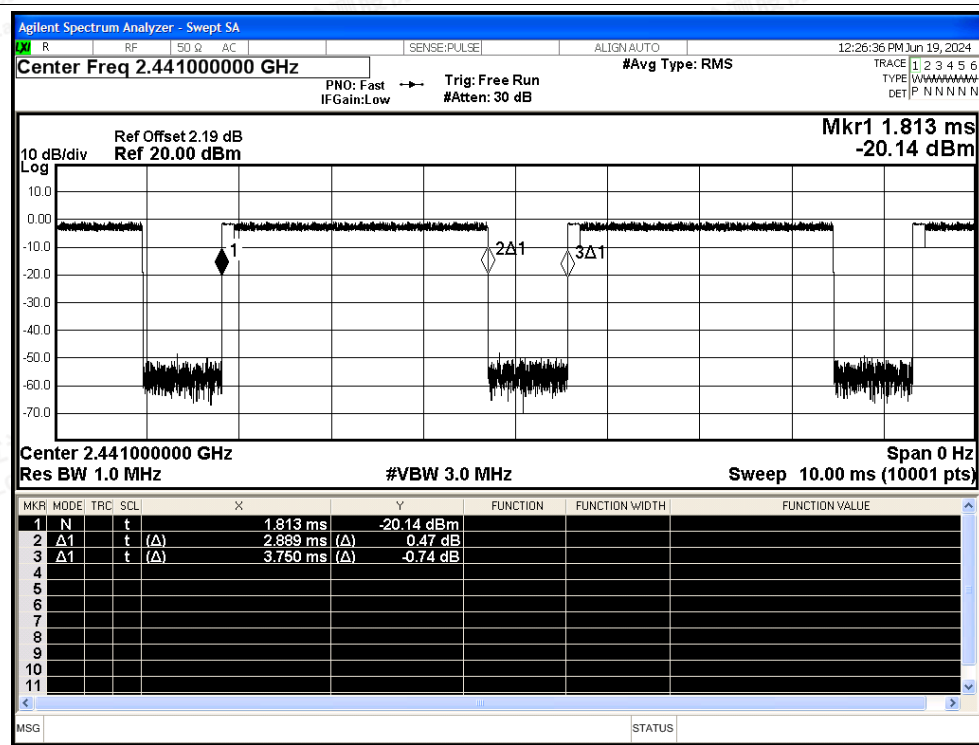


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

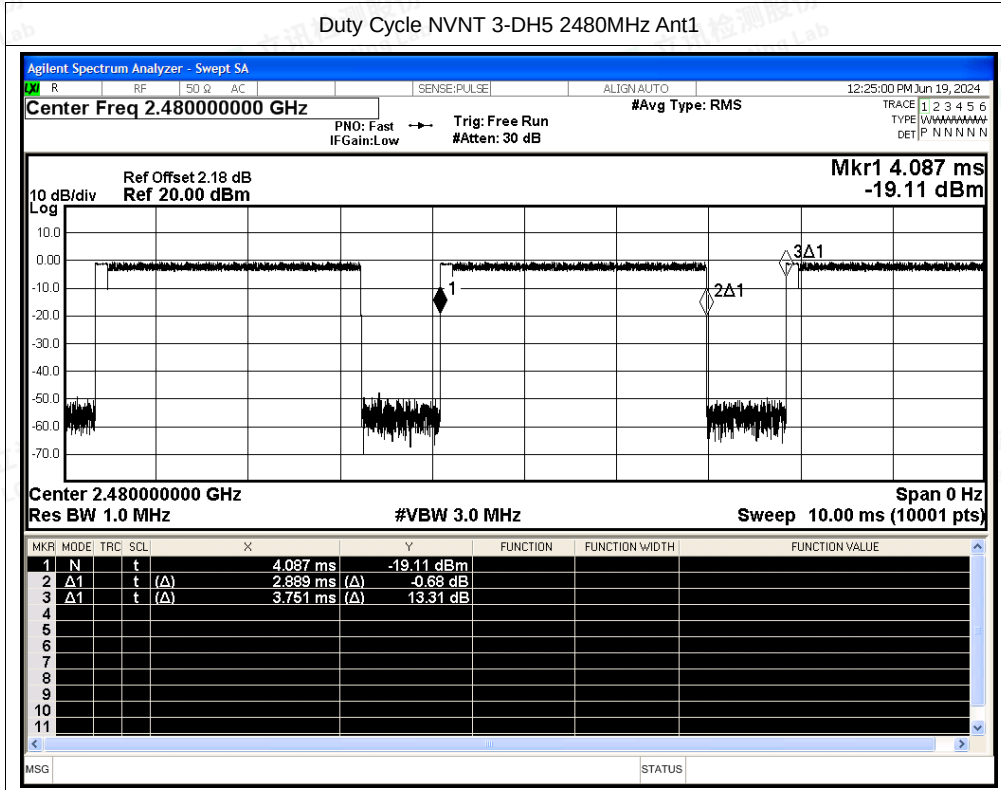

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



A.9 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Hopping Mode	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-49.43	2	-	47.83	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2310	-58.84	2	1.14	39.56	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2368.272	-47.28	2	-	49.98	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2359.536	-57.64	2	1.14	40.76	Average	54	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-47.4	2	-	49.86	Peak	74	Pass
NVNT	1-DH5	2402	Ant1	No-Hopping	2390	-58.5	2	1.14	39.90	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-50.09	2	-	47.17	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2483.5	-57.5	2	1.14	40.90	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2498.464	-46.68	2	-	50.58	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2494.408	-57.09	2	1.14	41.31	Average	54	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-50.69	2	-	46.57	Peak	74	Pass
NVNT	1-DH5	2480	Ant1	No-Hopping	2500	-58.19	2	1.14	40.21	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-50.33	2	-	46.93	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2310	-58.58	2	1.14	39.82	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2377.104	-47.78	2	-	49.48	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2368.848	-57.46	2	1.14	40.94	Average	54	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-50.87	2	-	46.39	Peak	74	Pass
NVNT	2-DH5	2402	Ant1	No-Hopping	2390	-58.46	2	1.14	39.94	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-49.35	2	-	47.91	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2483.5	-58.23	2	1.14	40.17	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2490.928	-46.86	2	-	50.40	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2489.104	-56.81	2	1.14	41.59	Average	54	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-50.21	2	-	47.05	Peak	74	Pass
NVNT	2-DH5	2480	Ant1	No-Hopping	2500	-58.91	2	1.14	39.49	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-50.22	2	-	47.04	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2310	-59.2	2	1.13	39.19	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2388.912	-47.43	2	-	49.83	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2340.144	-57.7	2	1.13	40.69	Average	54	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-51.07	2	-	46.19	Peak	74	Pass
NVNT	3-DH5	2402	Ant1	No-Hopping	2390	-58.59	2	1.13	39.80	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-47.14	2	-	50.12	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.5	-58.07	2	1.13	40.32	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2483.512	-47.14	2	-	50.12	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2487.496	-56.94	2	1.13	41.45	Average	54	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-50.8	2	-	46.46	Peak	74	Pass
NVNT	3-DH5	2480	Ant1	No-Hopping	2500	-57.11	2	1.13	41.28	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Peak

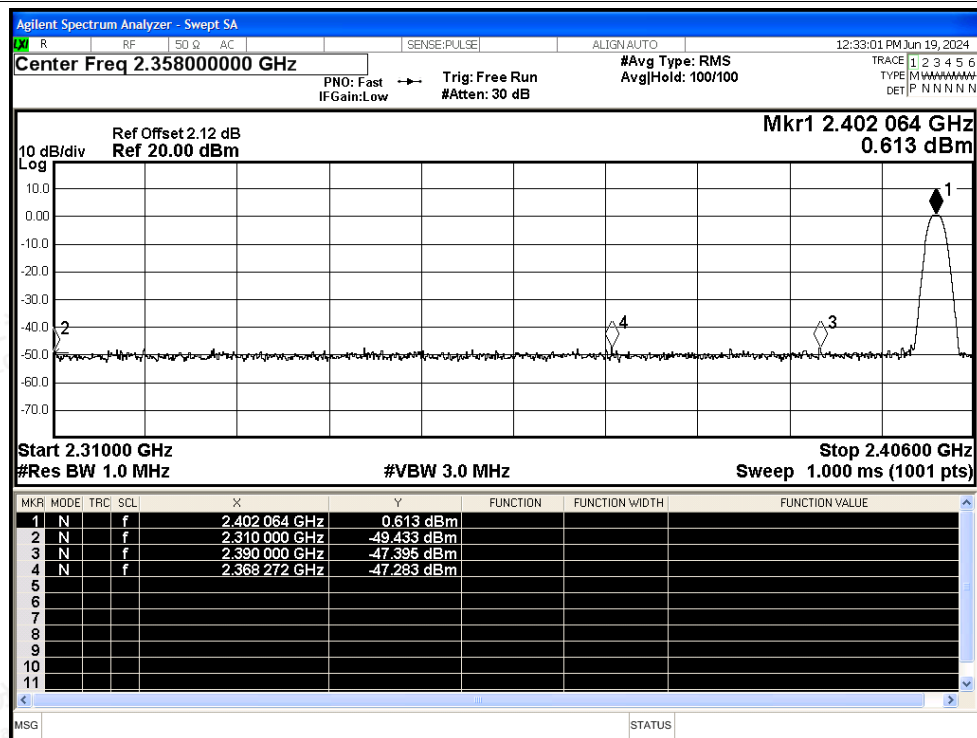

Restrict Band NVNT 1-DH5 2402MHz Ant1 No-Hopping Average

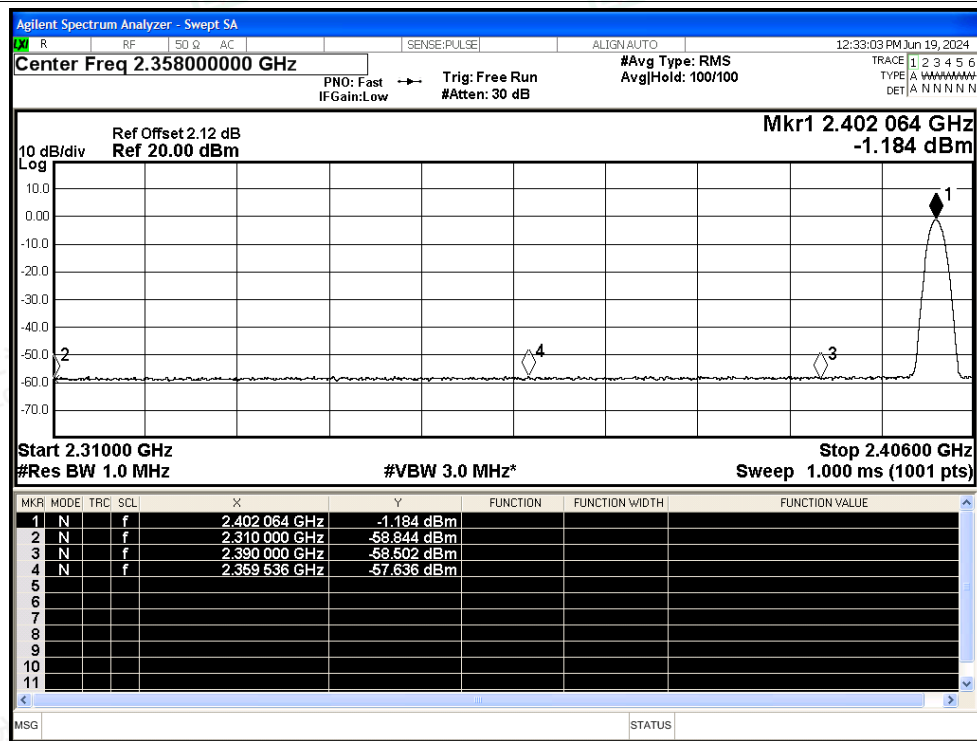

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Peak

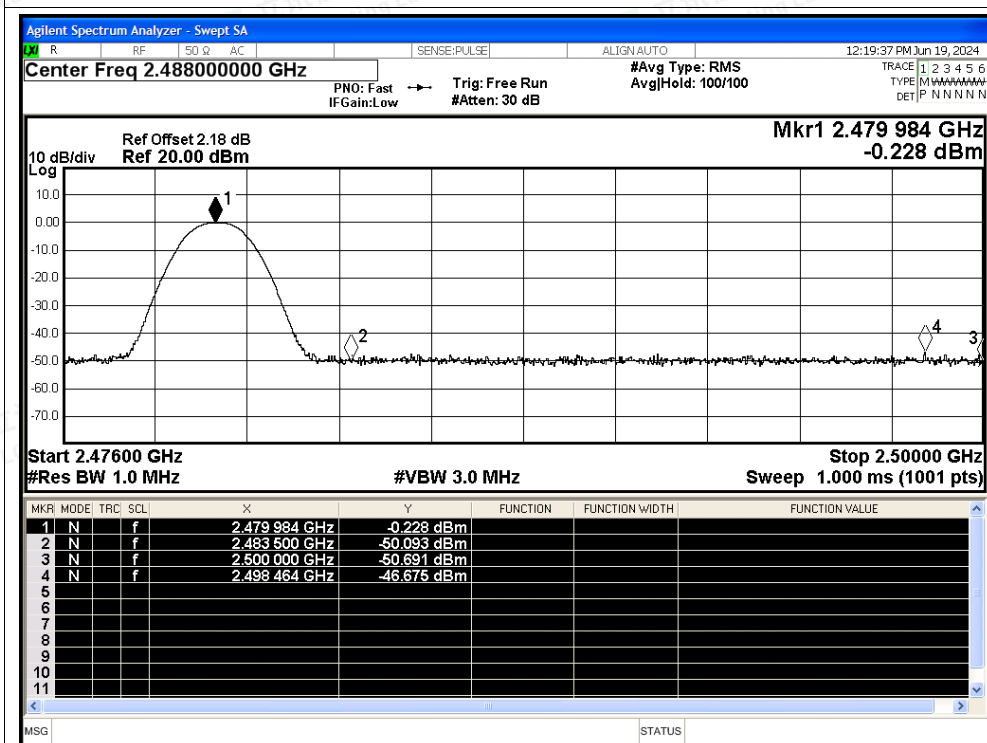

Restrict Band NVNT 1-DH5 2480MHz Ant1 No-Hopping Average

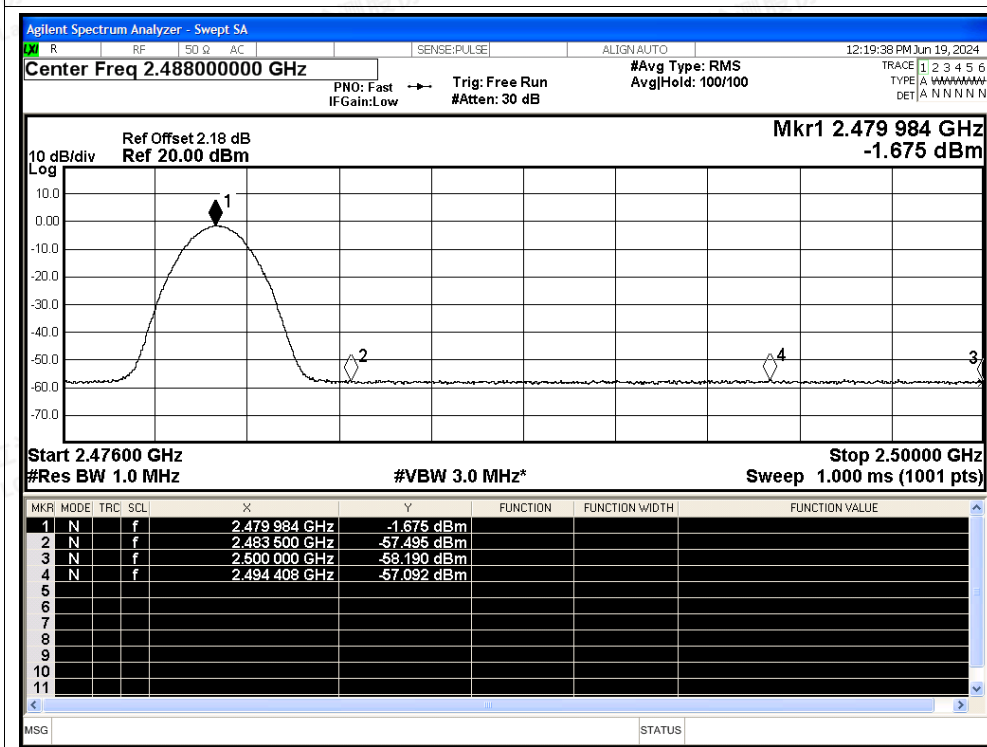

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Peak

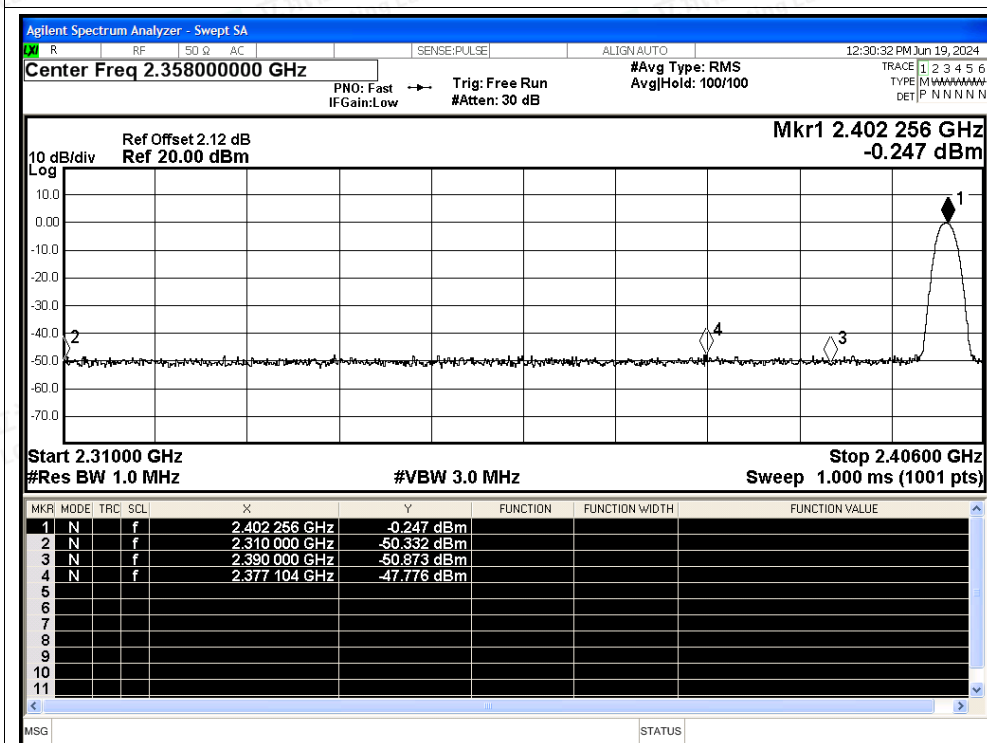

Restrict Band NVNT 2-DH5 2402MHz Ant1 No-Hopping Average

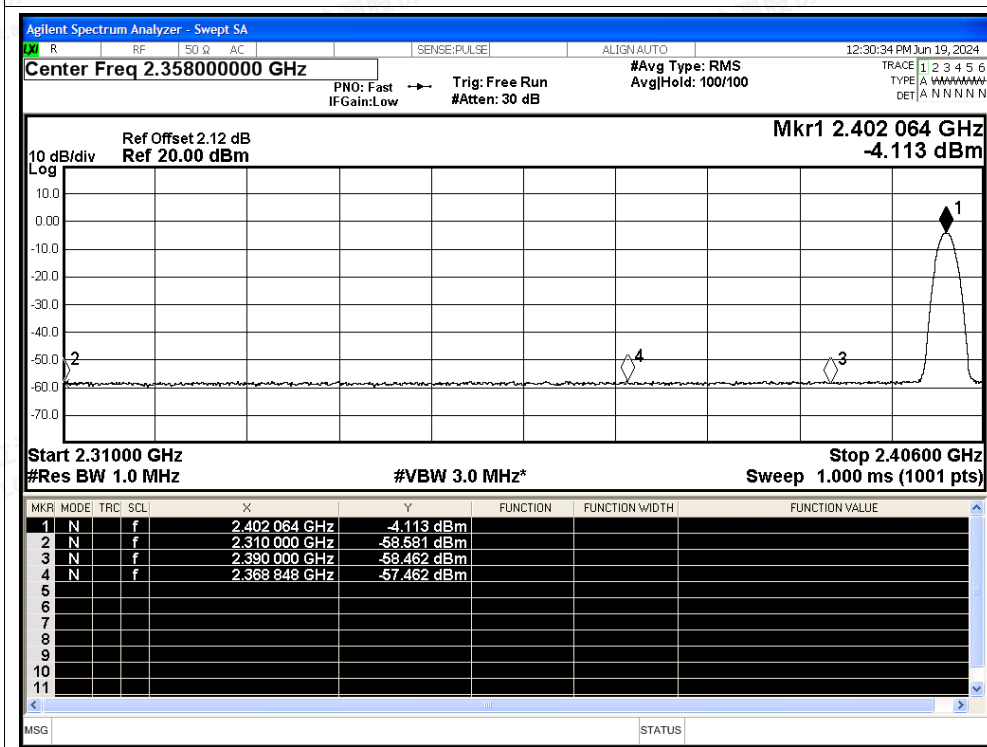

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Peak

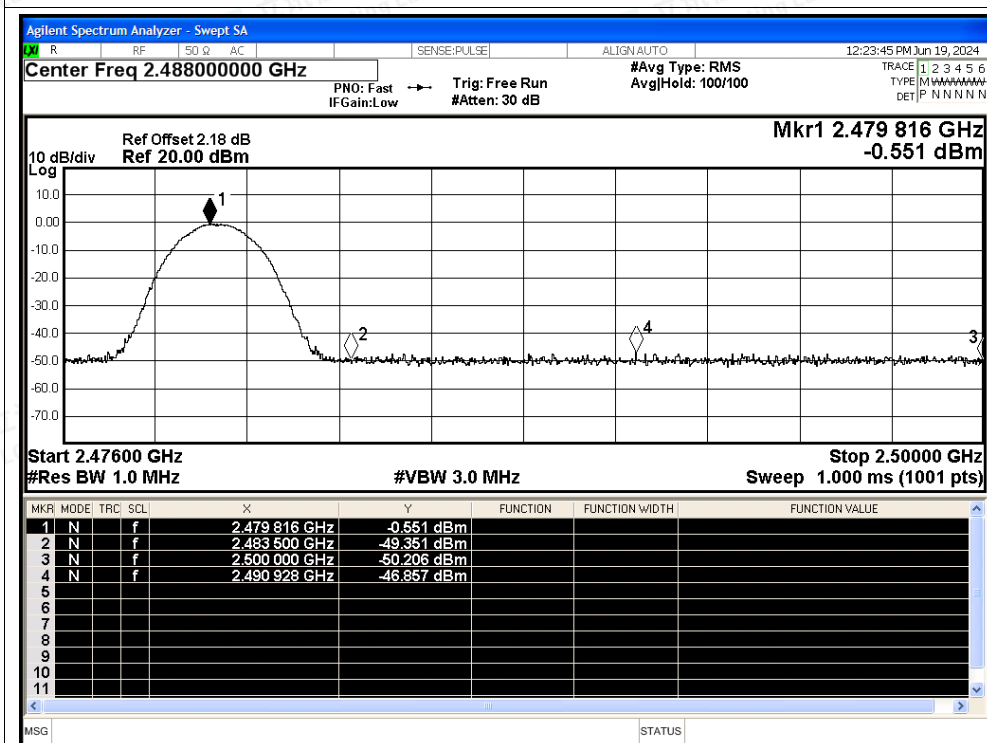

Restrict Band NVNT 2-DH5 2480MHz Ant1 No-Hopping Average

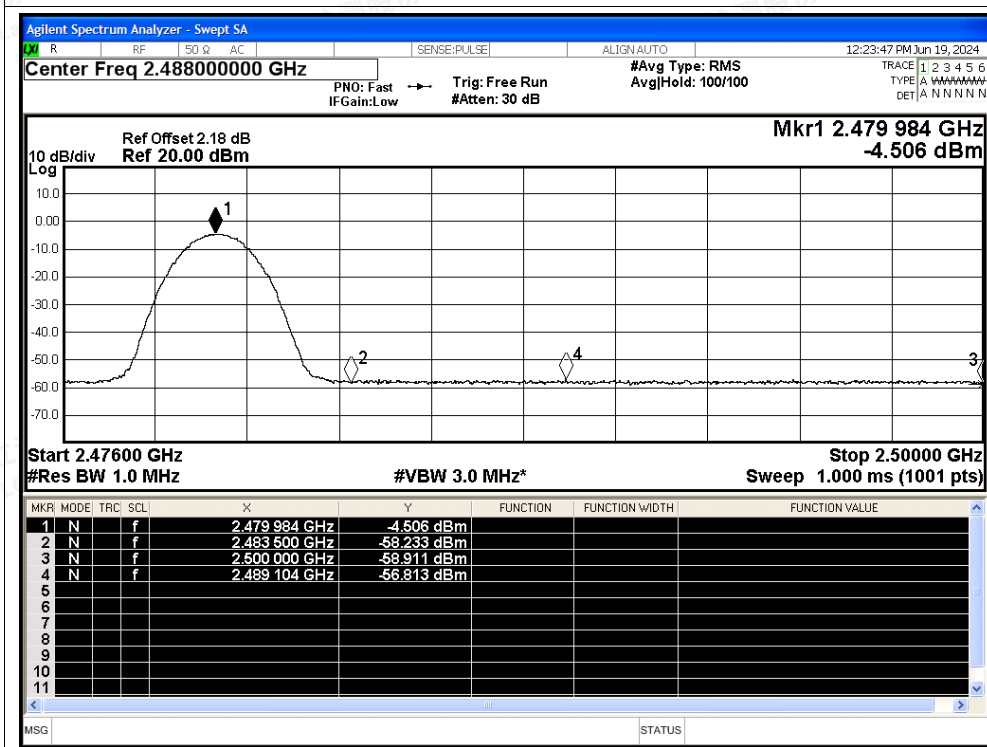

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Peak

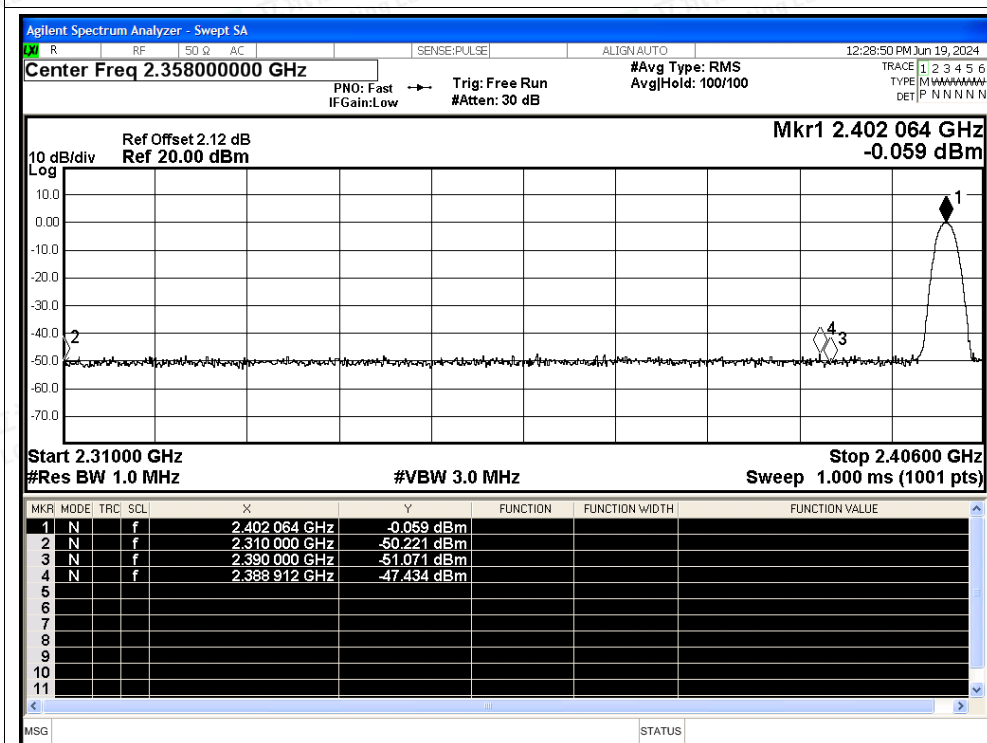

Restrict Band NVNT 3-DH5 2402MHz Ant1 No-Hopping Average

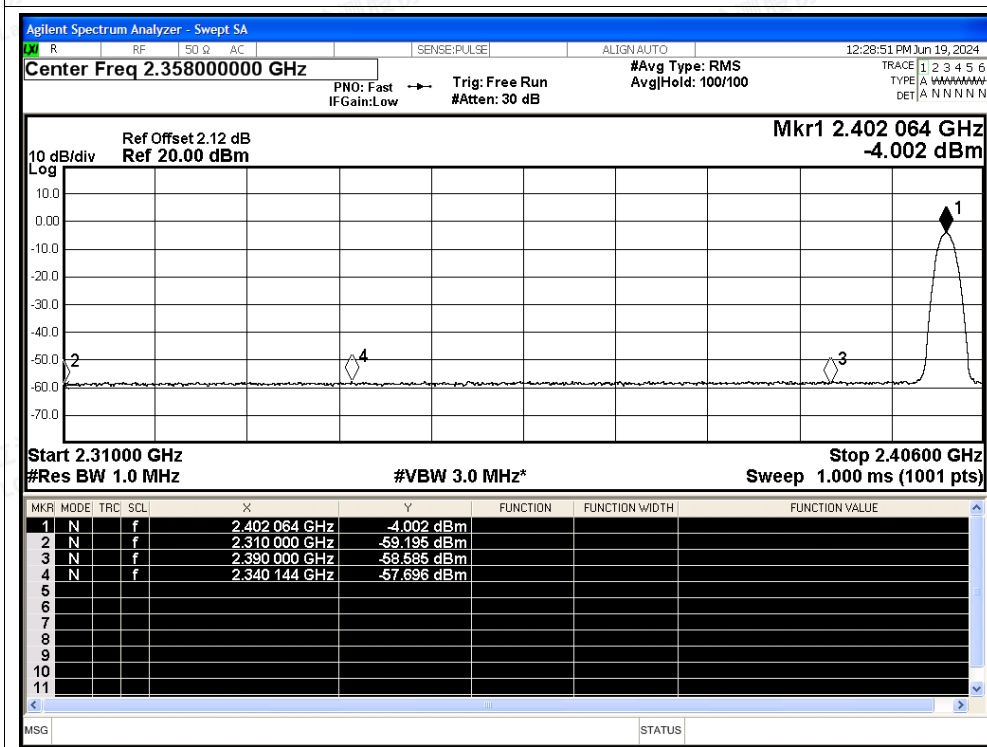

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Peak

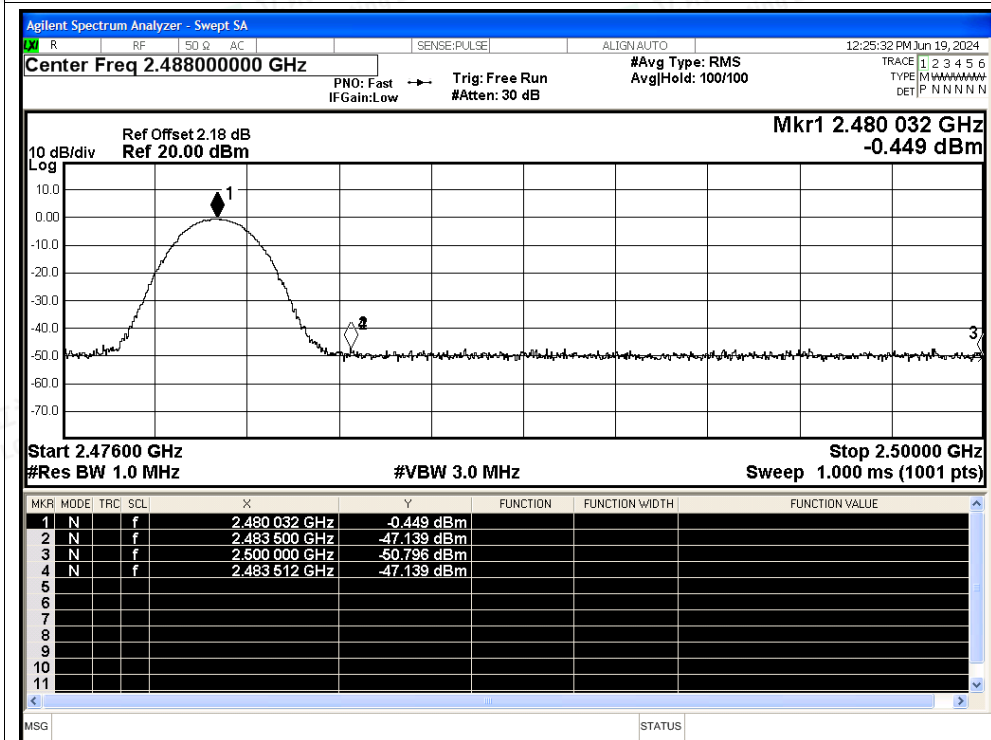

Restrict Band NVNT 3-DH5 2480MHz Ant1 No-Hopping Average

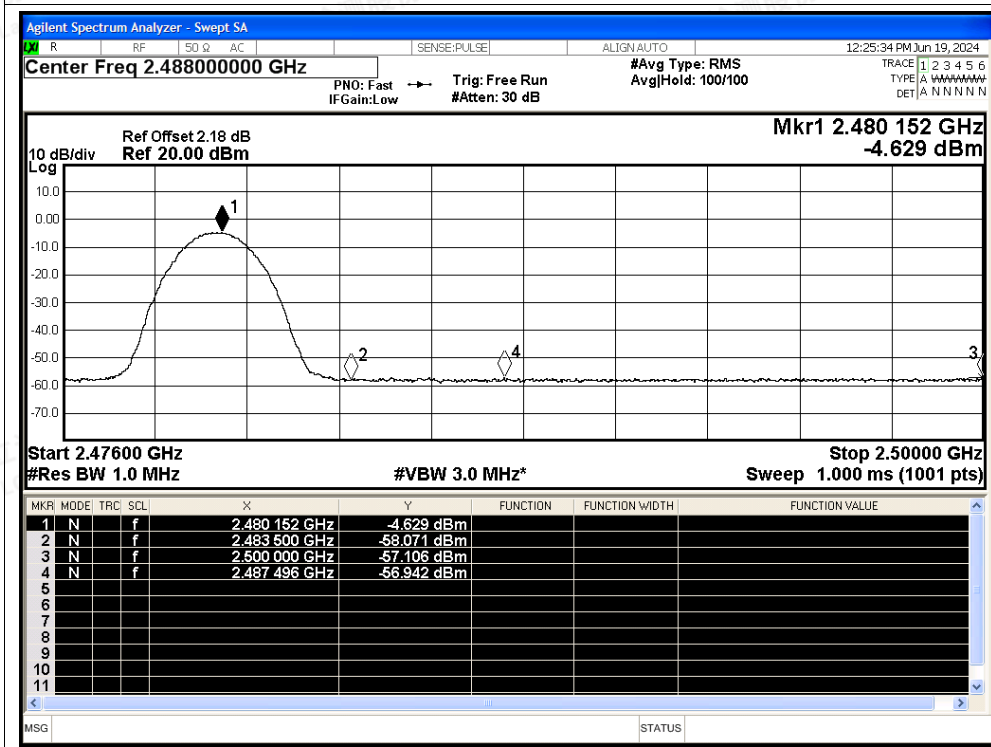

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity