




Test Graphs

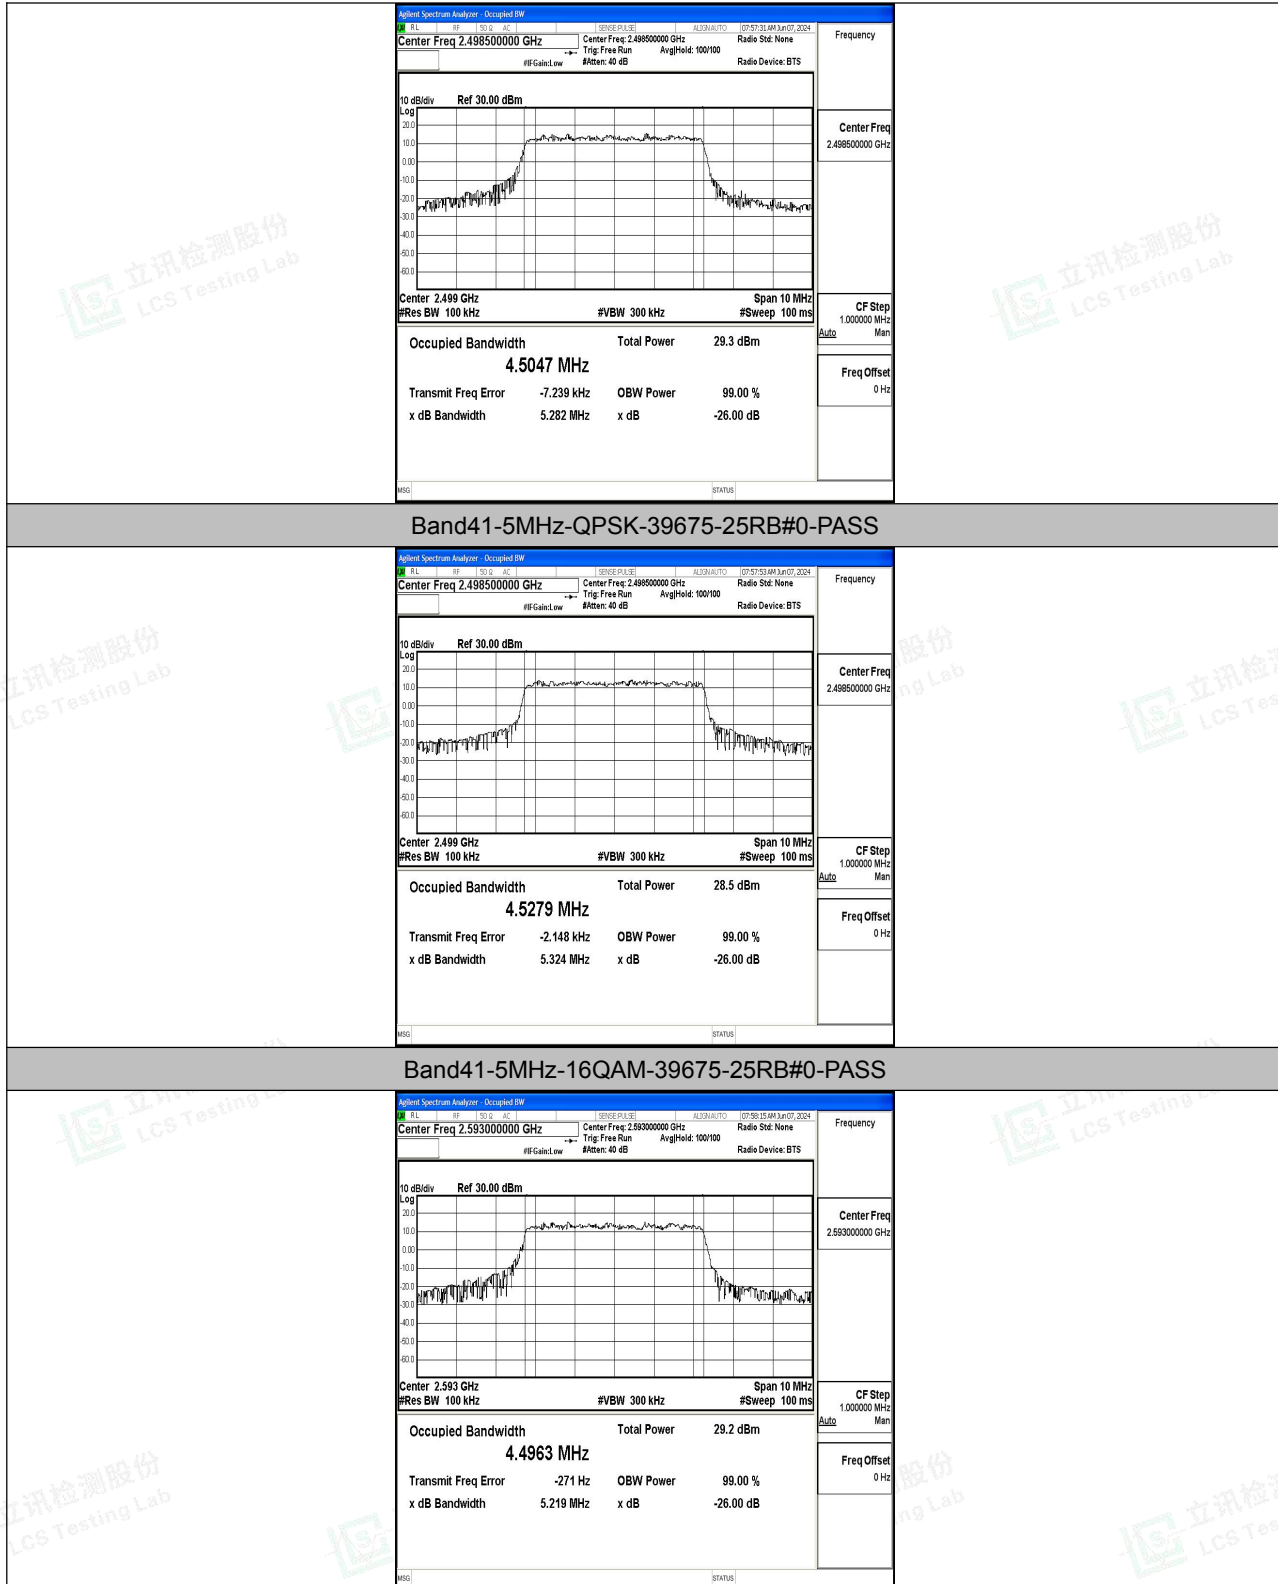

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41-5MHz-QPSK-40620-25RB#0-PASS

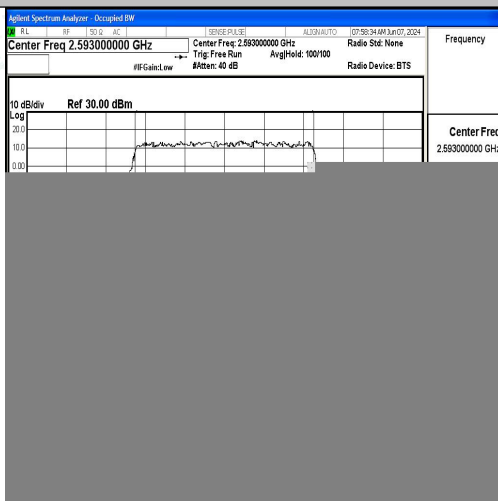

Band41-5MHz-16QAM-40620-25RB#0-PASS

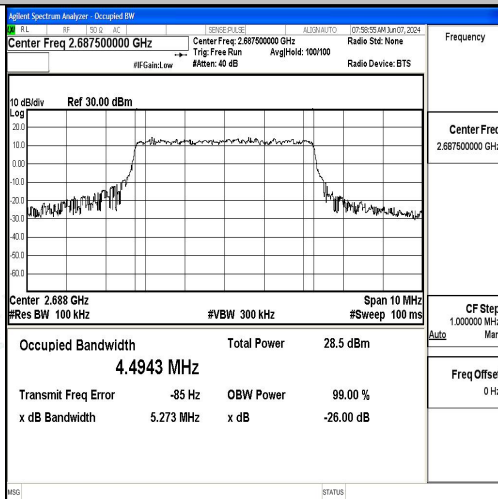

Band41-5MHz-QPSK-41565-25RB#0-PASS

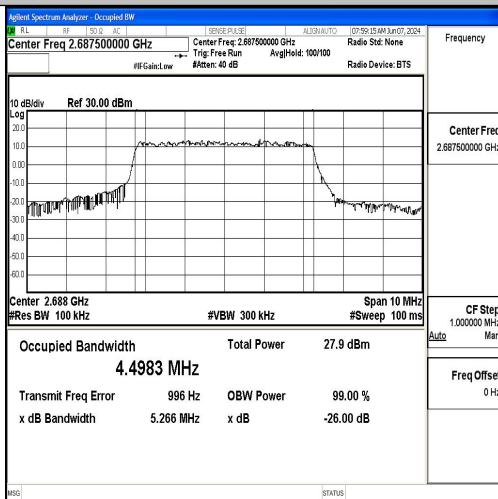

Band41-5MHz-16QAM-41565-25RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity











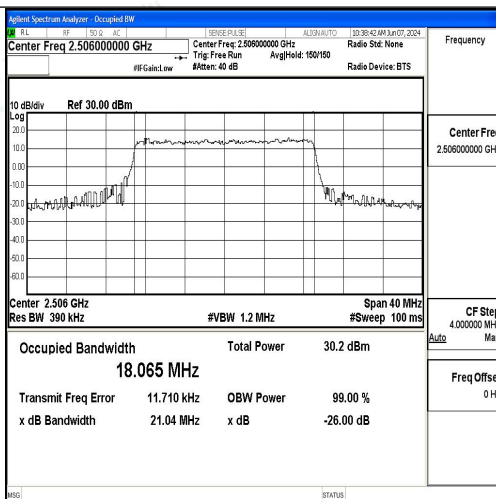

Band41-20MHz-QPSK-39750-100RB#0-PASS

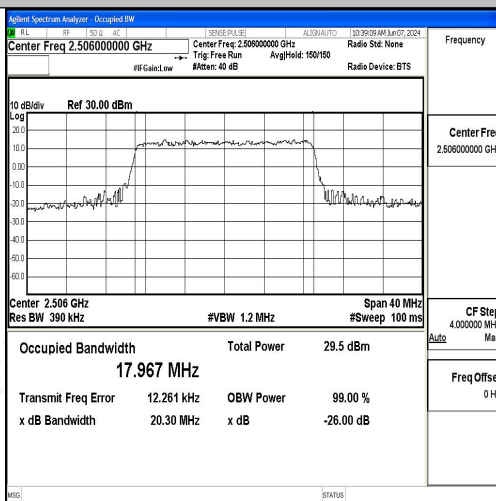

Band41-20MHz-16QAM-39750-100RB#0-PASS

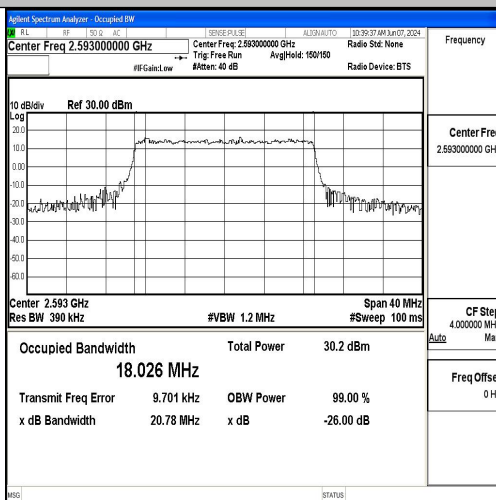

Band41-20MHz-QPSK-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Shenzhen EEC Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen,
518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

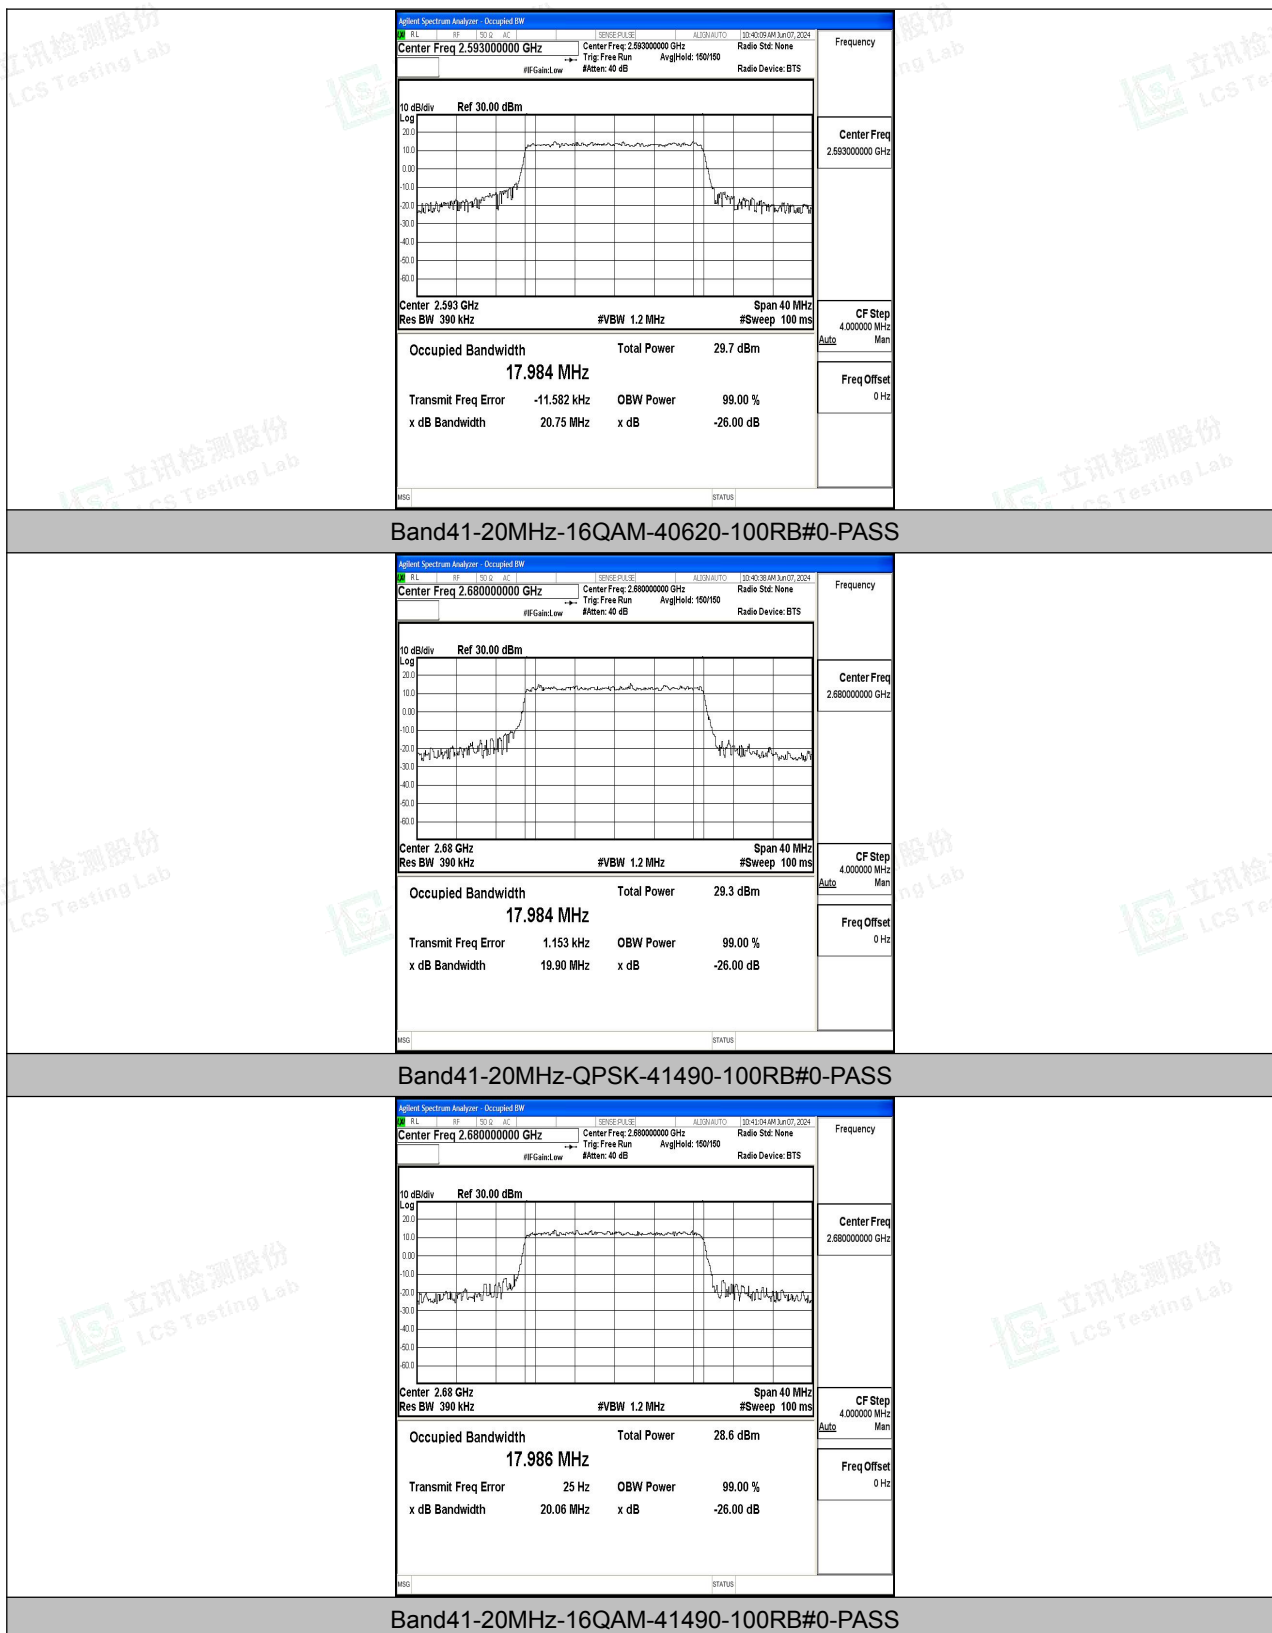

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




B.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.41	-43.69	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.43	-43.70	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.13	-44.21	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.07	-45.45	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-36.21	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.41	-37.30	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.45	-40.80	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.05	-41.68	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.50	-33.69	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.43	-33.78	PASS
Band41	15MHz	QPSK	41515	75RB#0	2706.01	-39.68	PASS
Band41	15MHz	16QAM	41515	75RB#0	2706.12	-40.39	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.26	-33.09	PASS
Band41	20MHz	16QAM	39750	100RB#0	2489.46	-33.45	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.59	-39.96	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.01	-41.03	PASS

Test Graphs

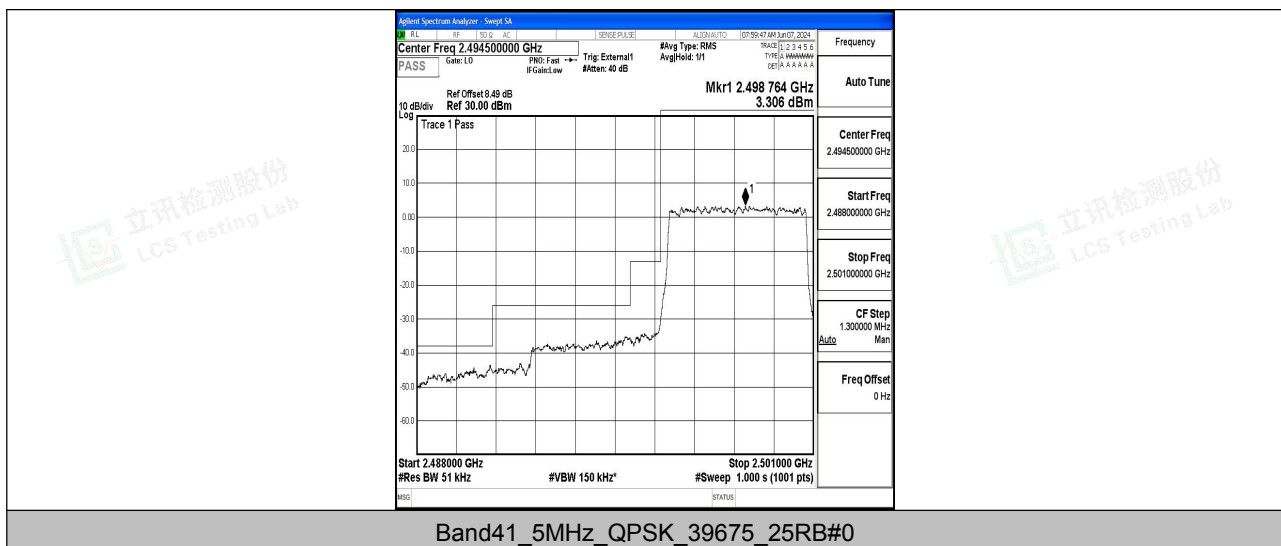

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



B.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-68.78	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-60.39	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-61.95	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~20000	-33.25	PASS
Band41	5MHz	QPSK	39675	1RB#0	20000~27000	-34.64	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-66.89	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-59.60	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-62.35	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~20000	-33.43	PASS
Band41	5MHz	16QAM	39675	1RB#0	20000~27000	-35.35	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-67.78	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-59.24	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-62.26	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~20000	-32.89	PASS
Band41	5MHz	QPSK	40620	1RB#0	20000~27000	-35.17	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-70.23	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-62.71	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-61.77	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~20000	-33.26	PASS
Band41	5MHz	16QAM	40620	1RB#0	20000~27000	-35.42	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-64.64	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-59.92	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-62.34	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~20000	-33.37	PASS
Band41	5MHz	QPSK	41565	1RB#0	20000~27000	-34.99	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-67.91	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-59.72	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-62.21	PASS
Band41	5MHz	16QAM	41565	1RB#0	1000~20000	-33.31	PASS
Band41	5MHz	16QAM	41565	1RB#0	20000~27000	-35.49	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-68.69	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-58.33	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-62.20	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~20000	-33.01	PASS
Band41	10MHz	QPSK	39700	1RB#0	20000~27000	-35.12	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-67.64	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-62.63	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-61.87	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~20000	-33.19	PASS
Band41	10MHz	16QAM	39700	1RB#0	20000~27000	-35.22	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-67.06	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-58.42	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-62.16	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~20000	-33.49	PASS
Band41	10MHz	QPSK	40620	1RB#0	20000~27000	-35.04	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-68.25	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-60.34	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-61.86	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~20000	-32.58	PASS
Band41	10MHz	16QAM	40620	1RB#0	20000~27000	-35.25	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-65.59	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-60.16	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-62.05	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~20000	-32.99	PASS
Band41	10MHz	QPSK	41540	1RB#0	20000~27000	-35.34	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-68.23	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-60.92	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-62.15	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~20000	-33.28	PASS
Band41	10MHz	16QAM	41540	1RB#0	20000~27000	-35.27	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-68.51	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-59.20	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-62.25	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~20000	-33.10	PASS
Band41	15MHz	QPSK	39725	1RB#0	20000~27000	-34.98	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-67.82	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-61.95	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-62.10	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~20000	-33.20	PASS
Band41	15MHz	16QAM	39725	1RB#0	20000~27000	-35.31	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-69.34	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-61.57	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-62.03	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~20000	-33.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	20000~27000	-35.32	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-68.57	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-59.91	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	40620	1RB#0	30~1000	-62.12	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~20000	-33.14	PASS
Band41	15MHz	16QAM	40620	1RB#0	20000~27000	-35.23	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-68.30	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-58.24	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-62.15	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~20000	-33.29	PASS
Band41	15MHz	QPSK	41515	1RB#0	20000~27000	-35.04	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-67.28	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-58.04	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-62.06	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~20000	-32.85	PASS
Band41	15MHz	16QAM	41515	1RB#0	20000~27000	-35.20	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-69.89	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-61.16	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-62.32	PASS
Band41	20MHz	QPSK	39750	1RB#0	1000~20000	-33.11	PASS
Band41	20MHz	QPSK	39750	1RB#0	20000~27000	-35.20	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-66.44	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-58.58	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-62.09	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~20000	-32.99	PASS
Band41	20MHz	16QAM	39750	1RB#0	20000~27000	-35.37	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-68.47	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-57.23	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-61.79	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~20000	-33.30	PASS
Band41	20MHz	QPSK	40620	1RB#0	20000~27000	-34.95	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-68.24	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-62.42	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-61.84	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~20000	-33.19	PASS
Band41	20MHz	16QAM	40620	1RB#0	20000~27000	-34.99	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-66.49	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-62.70	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-62.20	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~20000	-33.21	PASS
Band41	20MHz	QPSK	41490	1RB#0	20000~27000	-35.06	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-67.19	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-62.46	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-62.24	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~20000	-33.22	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	16QAM	41490	1RB#0	20000~27000	-35.09	PASS
--------	-------	-------	-------	-------	-------------	--------	------

Test Graphs

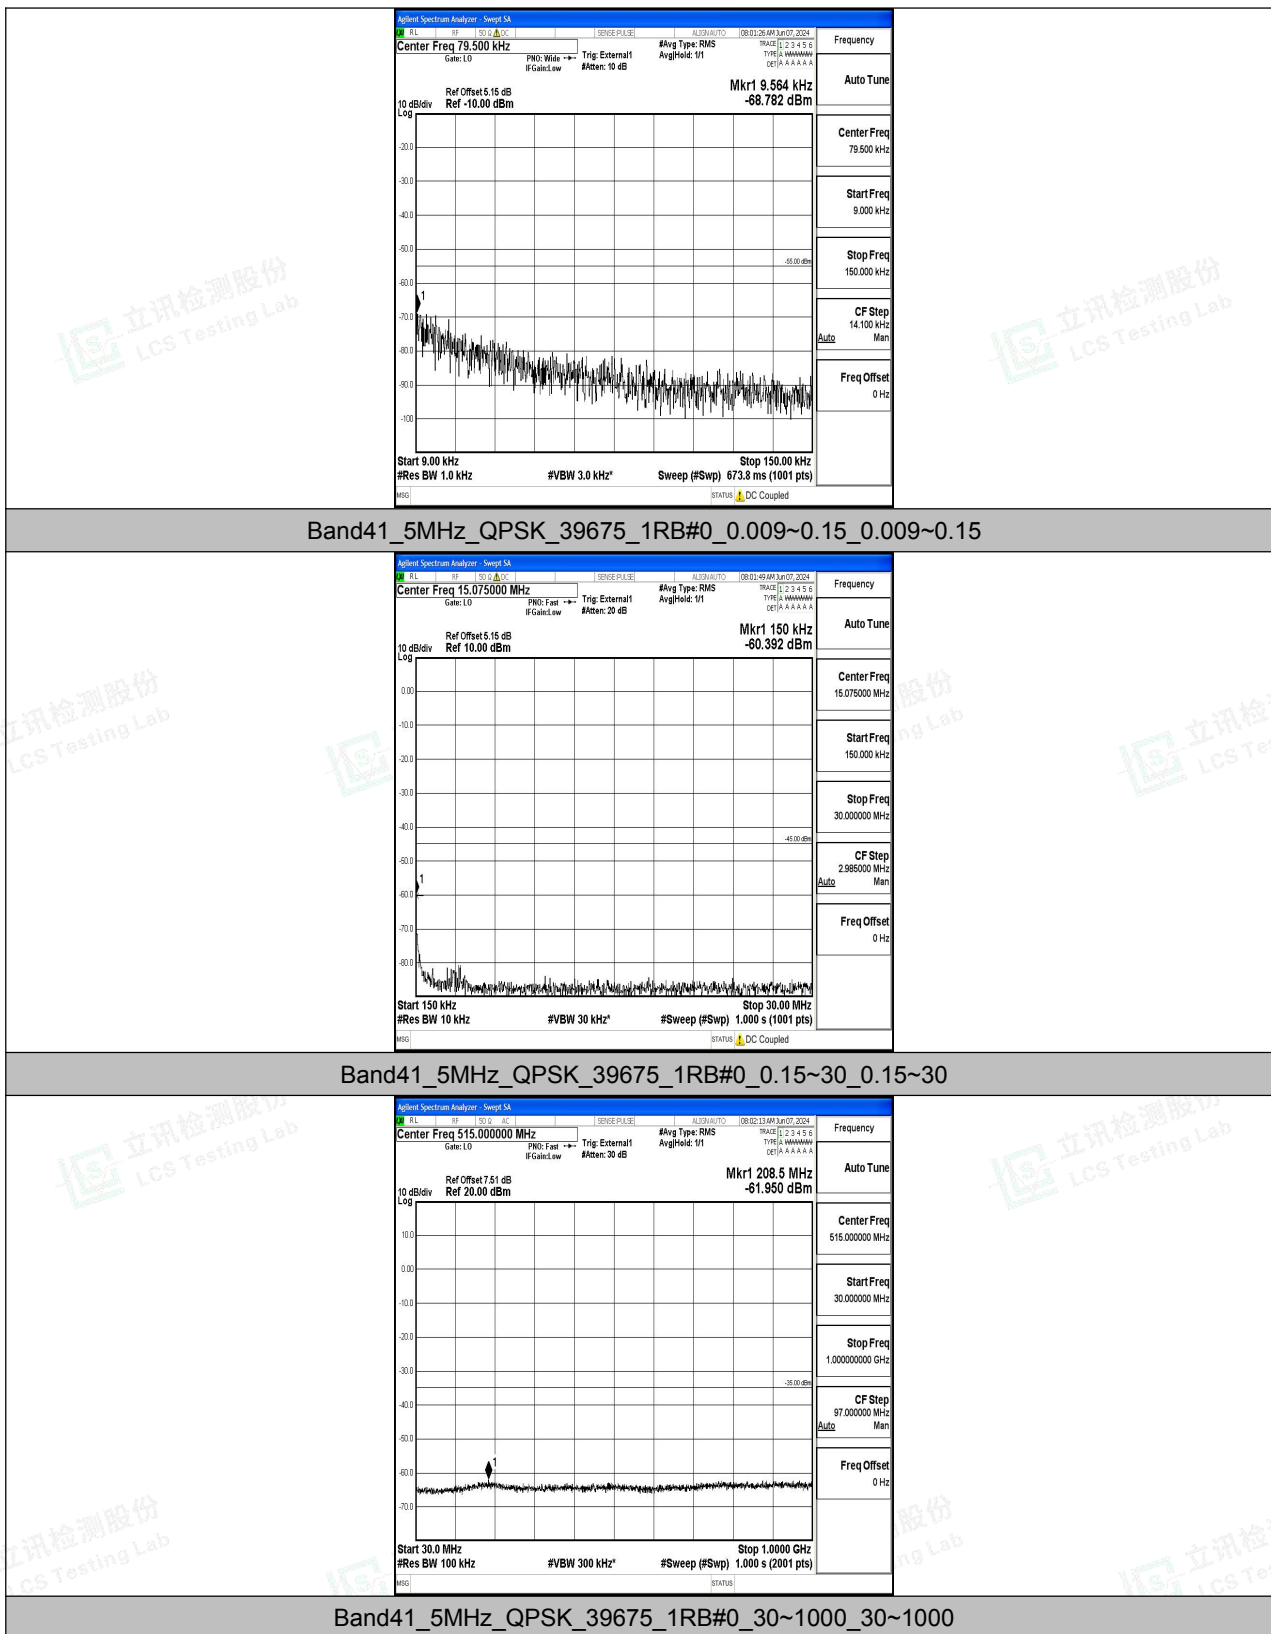


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

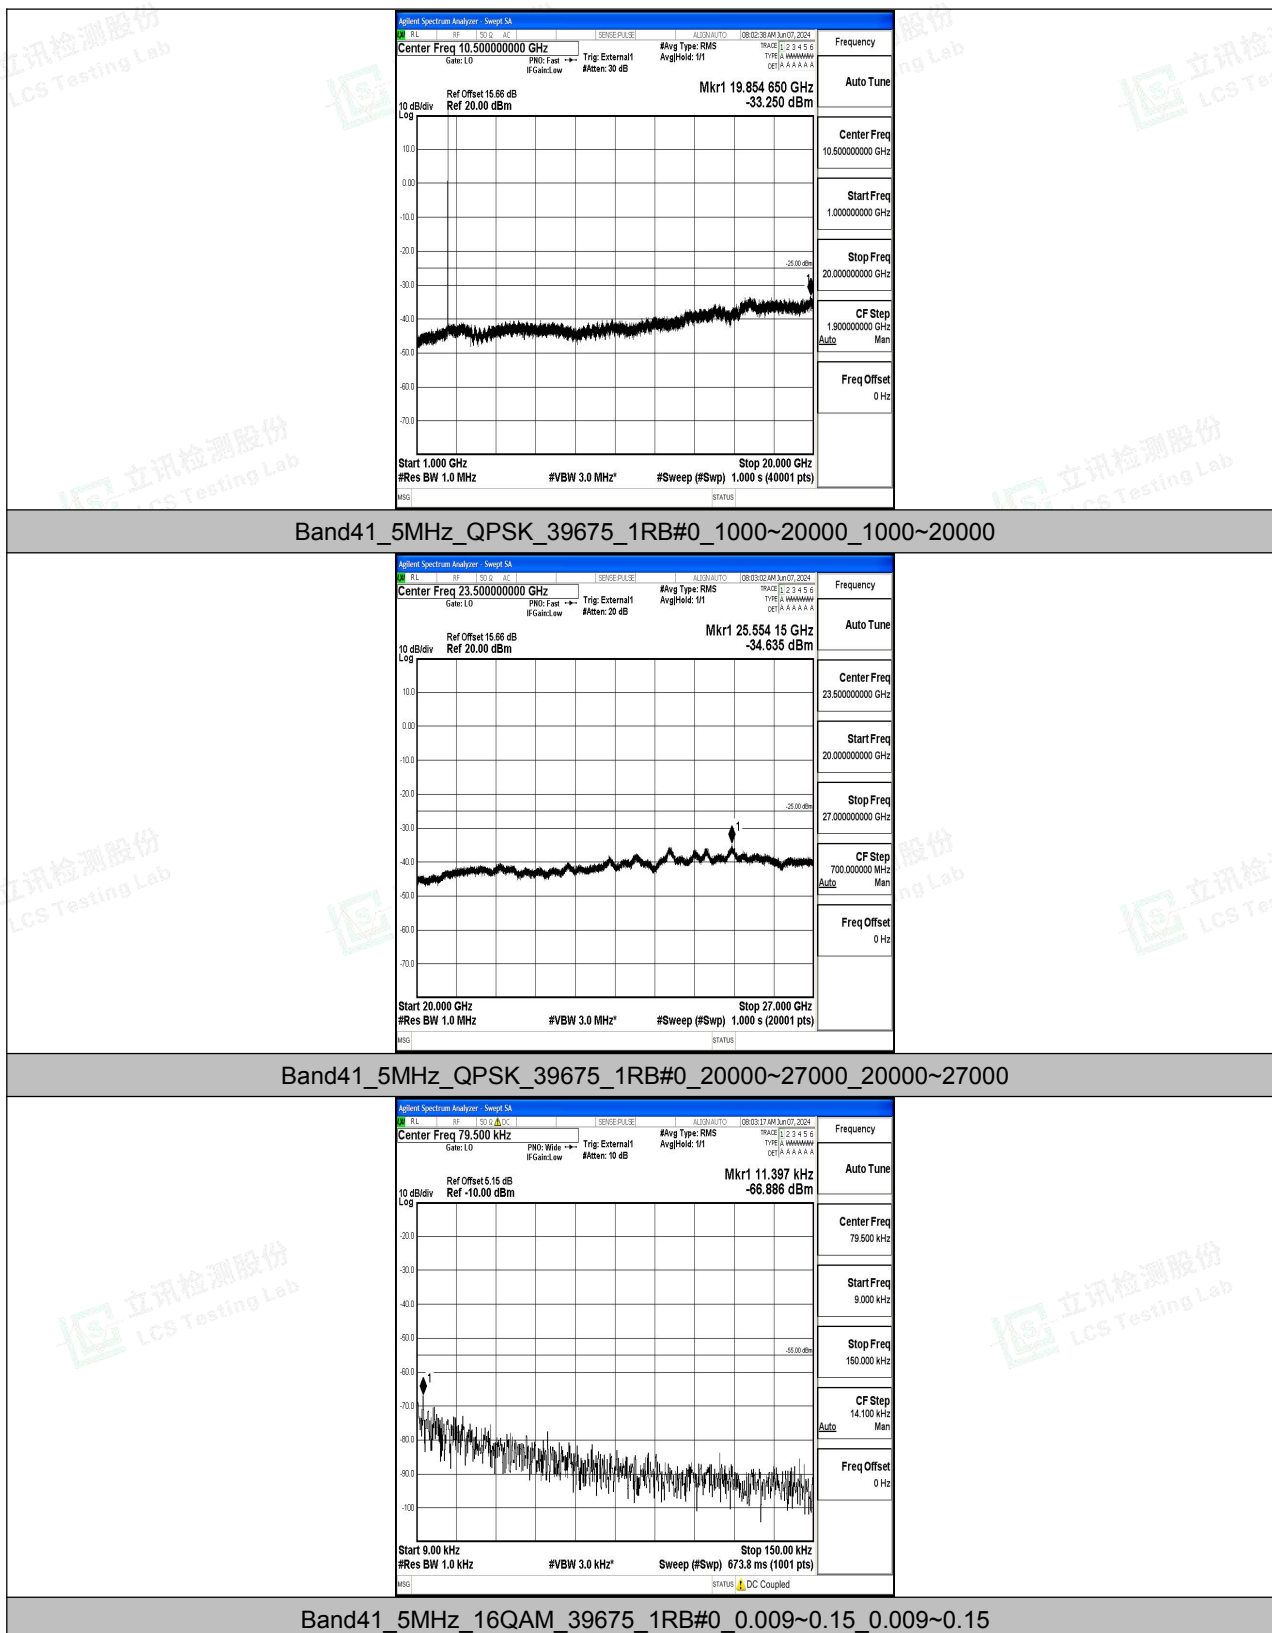

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity