

Appendix Test Data

Report No.:	18220WC40091006	Test Sample No.:	1-2-2
Start Test Date:	2024.4.29	Finish Test Date:	2023.5.25
Test Engineer:	Hayman Chen	Auditor:	Justin Feng
Temperature:	24.3℃	Relative Humidity:	57 %
Pressure:	101 kPa		

Appendix A: Conducted Output Power

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	1RB#0	21.91	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	21.21	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#12	21.59	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#12	20.98	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#24	22.00	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#24	21.34	PASS
41(2535-2655)	5MHz	QPSK	40065	12RB#0	20.91	PASS
41(2535-2655)	5MHz	16QAM	40065	12RB#0	19.83	PASS
41(2535-2655)	5MHz	QPSK	40065	12RB#6	20.90	PASS
41(2535-2655)	5MHz	16QAM	40065	12RB#6	19.82	PASS
41(2535-2655)	5MHz	QPSK	40065	12RB#13	21.11	PASS
41(2535-2655)	5MHz	16QAM	40065	12RB#13	19.99	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	21.00	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	19.87	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#0	21.76	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#0	21.09	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#12	21.44	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#12	20.72	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#24	21.75	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#24	21.16	PASS
41(2535-2655)	5MHz	QPSK	40590	12RB#0	20.95	PASS
41(2535-2655)	5MHz	16QAM	40590	12RB#0	19.86	PASS
41(2535-2655)	5MHz	QPSK	40590	12RB#6	20.95	PASS
41(2535-2655)	5MHz	16QAM	40590	12RB#6	19.86	PASS
41(2535-2655)	5MHz	QPSK	40590	12RB#13	21.00	PASS
41(2535-2655)	5MHz	16QAM	40590	12RB#13	19.95	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	20.96	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com

Hotline
400-003-0500
www.anbotek.com.cn



41(2535-2655)	5MHz	16QAM	40590	25RB#0	19.91	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	21.12	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	20.41	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#12	20.60	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#12	19.93	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#24	20.97	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#24	20.32	PASS
41(2535-2655)	5MHz	QPSK	41215	12RB#0	20.11	PASS
41(2535-2655)	5MHz	16QAM	41215	12RB#0	19.14	PASS
41(2535-2655)	5MHz	QPSK	41215	12RB#6	20.11	PASS
41(2535-2655)	5MHz	16QAM	41215	12RB#6	19.14	PASS
41(2535-2655)	5MHz	QPSK	41215	12RB#13	20.12	PASS
41(2535-2655)	5MHz	16QAM	41215	12RB#13	19.16	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	20.05	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	19.10	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	21.46	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	20.73	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#24	21.61	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#24	20.94	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#49	21.56	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#49	20.76	PASS
41(2535-2655)	10MHz	QPSK	40090	25RB#0	21.11	PASS
41(2535-2655)	10MHz	16QAM	40090	25RB#0	20.18	PASS
41(2535-2655)	10MHz	QPSK	40090	25RB#12	21.10	PASS
41(2535-2655)	10MHz	16QAM	40090	25RB#12	20.18	PASS
41(2535-2655)	10MHz	QPSK	40090	25RB#25	21.21	PASS
41(2535-2655)	10MHz	16QAM	40090	25RB#25	20.37	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	21.15	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	20.27	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#0	21.18	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#0	20.11	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#24	21.16	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#24	20.05	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#49	21.06	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#49	20.05	PASS
41(2535-2655)	10MHz	QPSK	40590	25RB#0	20.71	PASS
41(2535-2655)	10MHz	16QAM	40590	25RB#0	19.70	PASS
41(2535-2655)	10MHz	QPSK	40590	25RB#12	20.71	PASS
41(2535-2655)	10MHz	16QAM	40590	25RB#12	19.70	PASS
41(2535-2655)	10MHz	QPSK	40590	25RB#25	20.73	PASS
41(2535-2655)	10MHz	16QAM	40590	25RB#25	19.71	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	20.72	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	10MHz	16QAM	40590	50RB#0	19.72	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	21.15	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	20.24	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#24	20.95	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#24	20.14	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#49	20.78	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#49	19.93	PASS
41(2535-2655)	10MHz	QPSK	41190	25RB#0	20.47	PASS
41(2535-2655)	10MHz	16QAM	41190	25RB#0	19.62	PASS
41(2535-2655)	10MHz	QPSK	41190	25RB#12	20.47	PASS
41(2535-2655)	10MHz	16QAM	41190	25RB#12	19.62	PASS
41(2535-2655)	10MHz	QPSK	41190	25RB#25	20.31	PASS
41(2535-2655)	10MHz	16QAM	41190	25RB#25	19.49	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	20.37	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	19.53	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	22.02	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	21.31	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#38	22.11	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#38	21.46	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#74	22.46	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#74	21.76	PASS
41(2535-2655)	15MHz	QPSK	40115	38RB#0	21.56	PASS
41(2535-2655)	15MHz	16QAM	40115	38RB#0	21.56	PASS
41(2535-2655)	15MHz	QPSK	40115	38RB#18	21.56	PASS
41(2535-2655)	15MHz	16QAM	40115	38RB#18	21.56	PASS
41(2535-2655)	15MHz	QPSK	40115	38RB#37	21.56	PASS
41(2535-2655)	15MHz	16QAM	40115	38RB#37	21.56	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	21.56	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	20.66	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#0	21.88	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#0	20.90	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#38	21.71	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#38	20.66	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#74	21.79	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#74	20.80	PASS
41(2535-2655)	15MHz	QPSK	40590	38RB#0	21.00	PASS
41(2535-2655)	15MHz	16QAM	40590	38RB#0	21.00	PASS
41(2535-2655)	15MHz	QPSK	40590	38RB#18	21.00	PASS
41(2535-2655)	15MHz	16QAM	40590	38RB#18	21.00	PASS
41(2535-2655)	15MHz	QPSK	40590	38RB#37	21.00	PASS
41(2535-2655)	15MHz	16QAM	40590	38RB#37	21.00	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	21.00	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	15MHz	16QAM	40590	75RB#0	19.96	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	21.69	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	20.75	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#38	21.51	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#38	20.65	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#74	21.43	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#74	20.53	PASS
41(2535-2655)	15MHz	QPSK	41165	38RB#0	20.85	PASS
41(2535-2655)	15MHz	16QAM	41165	38RB#0	20.83	PASS
41(2535-2655)	15MHz	QPSK	41165	38RB#18	20.84	PASS
41(2535-2655)	15MHz	16QAM	41165	38RB#18	20.83	PASS
41(2535-2655)	15MHz	QPSK	41165	38RB#37	20.83	PASS
41(2535-2655)	15MHz	16QAM	41165	38RB#37	20.83	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	20.82	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	19.84	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	22.15	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#0	21.24	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#49	22.06	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#49	21.33	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#99	22.79	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#99	21.93	PASS
41(2535-2655)	20MHz	QPSK	40140	50RB#0	21.44	PASS
41(2535-2655)	20MHz	16QAM	40140	50RB#0	20.54	PASS
41(2535-2655)	20MHz	QPSK	40140	50RB#25	21.45	PASS
41(2535-2655)	20MHz	16QAM	40140	50RB#25	20.54	PASS
41(2535-2655)	20MHz	QPSK	40140	50RB#50	21.82	PASS
41(2535-2655)	20MHz	16QAM	40140	50RB#50	20.88	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	21.60	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	20.67	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#0	21.96	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#0	20.66	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#49	21.57	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#49	20.30	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#99	21.81	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#99	20.47	PASS
41(2535-2655)	20MHz	QPSK	40590	50RB#0	21.09	PASS
41(2535-2655)	20MHz	16QAM	40590	50RB#0	20.08	PASS
41(2535-2655)	20MHz	QPSK	40590	50RB#25	21.10	PASS
41(2535-2655)	20MHz	16QAM	40590	50RB#25	20.08	PASS
41(2535-2655)	20MHz	QPSK	40590	50RB#50	21.02	PASS
41(2535-2655)	20MHz	16QAM	40590	50RB#50	20.00	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	21.05	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	20MHz	16QAM	40590	100RB#0	20.02	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	21.98	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	20.88	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#49	21.73	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#49	20.69	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#99	21.63	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#99	20.54	PASS
41(2535-2655)	20MHz	QPSK	41140	50RB#0	20.98	PASS
41(2535-2655)	20MHz	16QAM	41140	50RB#0	19.96	PASS
41(2535-2655)	20MHz	QPSK	41140	50RB#25	20.99	PASS
41(2535-2655)	20MHz	16QAM	41140	50RB#25	19.96	PASS
41(2535-2655)	20MHz	QPSK	41140	50RB#50	20.93	PASS
41(2535-2655)	20MHz	16QAM	41140	50RB#50	19.85	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	20.91	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	19.94	PASS



Appendix B: Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
41(2535-2655)	5MHz	QPSK	40065	1RB#0	6.45	13	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	7.16	13	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	7.87	13	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	8.31	13	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#0	6.35	13	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#0	7.51	13	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	7.53	13	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	8.37	13	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	7.14	13	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	7.65	13	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	8.35	13	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	9.06	13	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	6.62	13	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	7.85	13	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	7.92	13	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	9.24	13	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#0	6.97	13	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#0	7.92	13	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	7.40	13	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	9.14	13	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	6.96	13	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	7.92	13	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	8.32	13	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	9.32	13	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	7.10	13	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	7.68	13	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	8.78	13	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	9.05	13	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#0	6.64	13	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#0	7.61	13	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	8.38	13	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	9.12	13	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	7.58	13	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	8.12	13	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	8.85	13	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	9.14	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



41(2535-2655)	20MHz	QPSK	40140	1RB#0	6.79	13	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#0	7.13	13	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	8.36	13	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	9.21	13	PASS
41(2535-2655)	20MHz	QPSK	40590	1RB#0	6.87	13	PASS
41(2535-2655)	20MHz	16QAM	40590	1RB#0	6.69	13	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	8.03	13	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	9.04	13	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	7.27	13	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	7.90	13	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	8.64	13	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	9.10	13	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Test Graphs

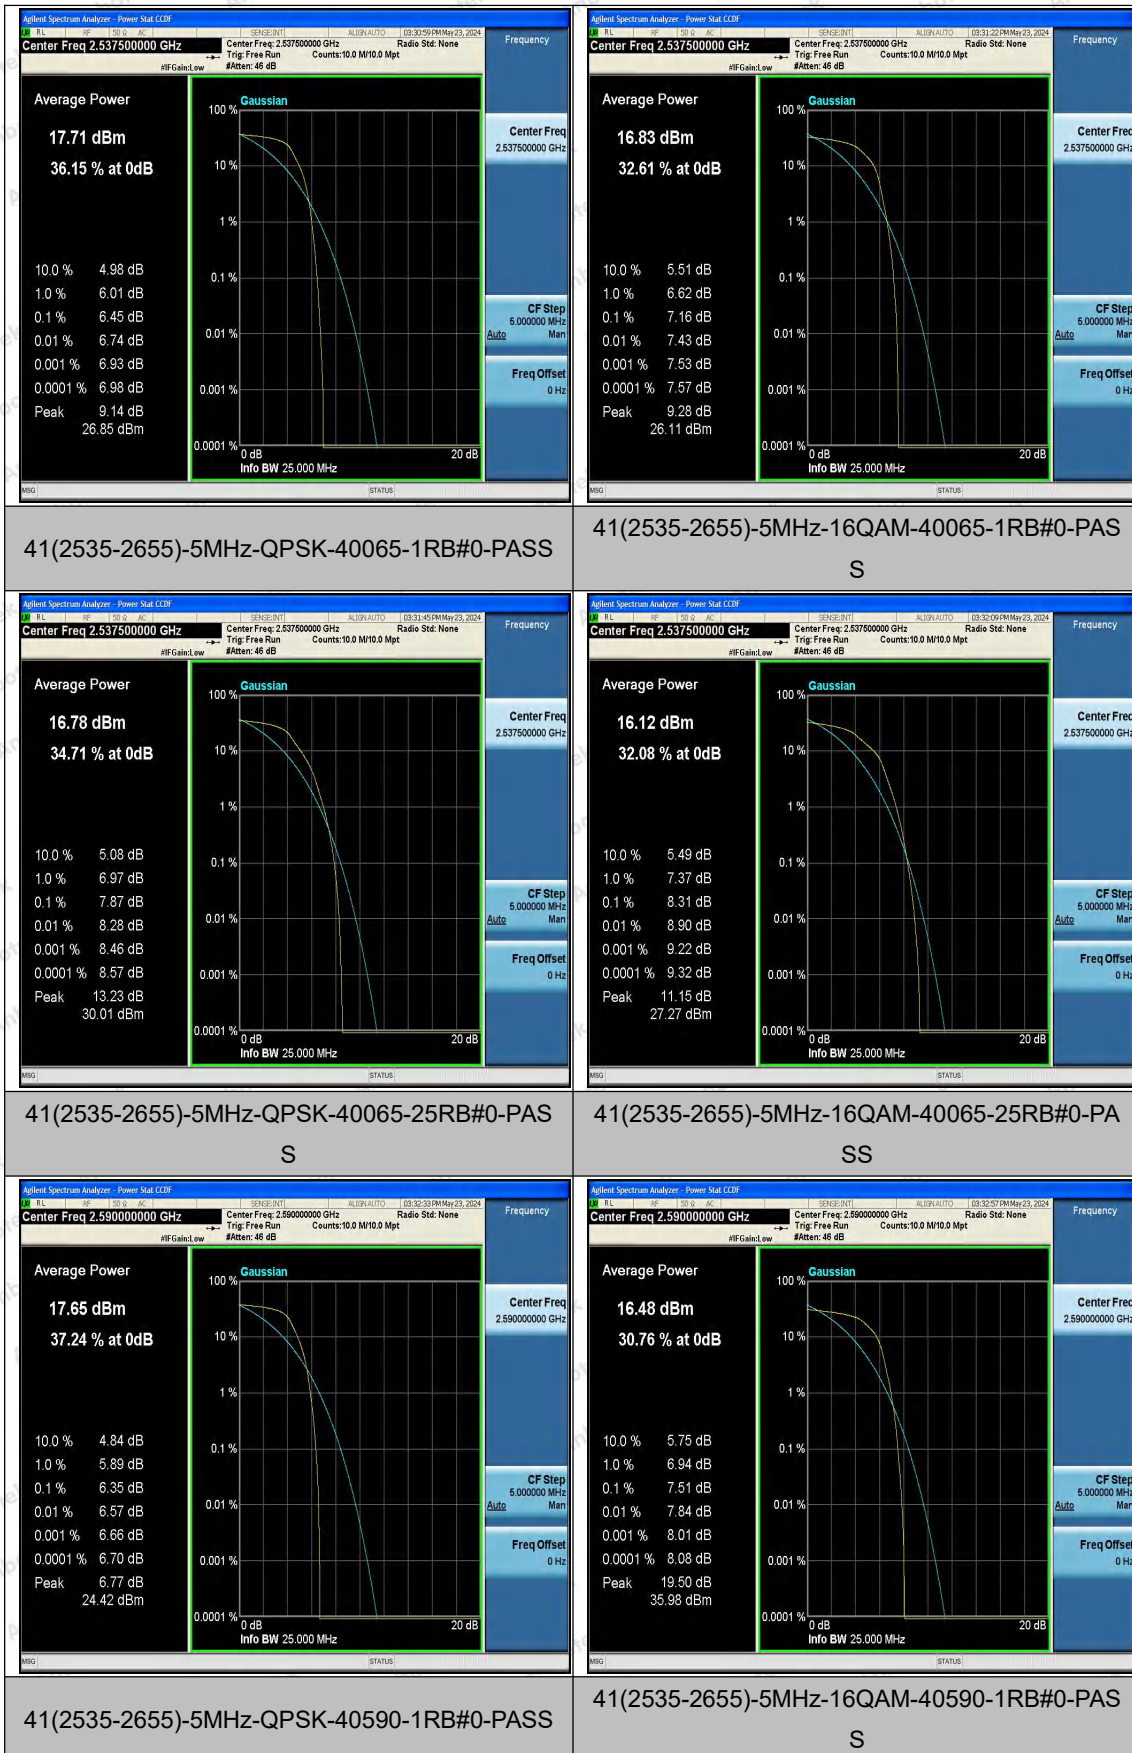


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
 400-003-0500
 www.anbotek.com.cn



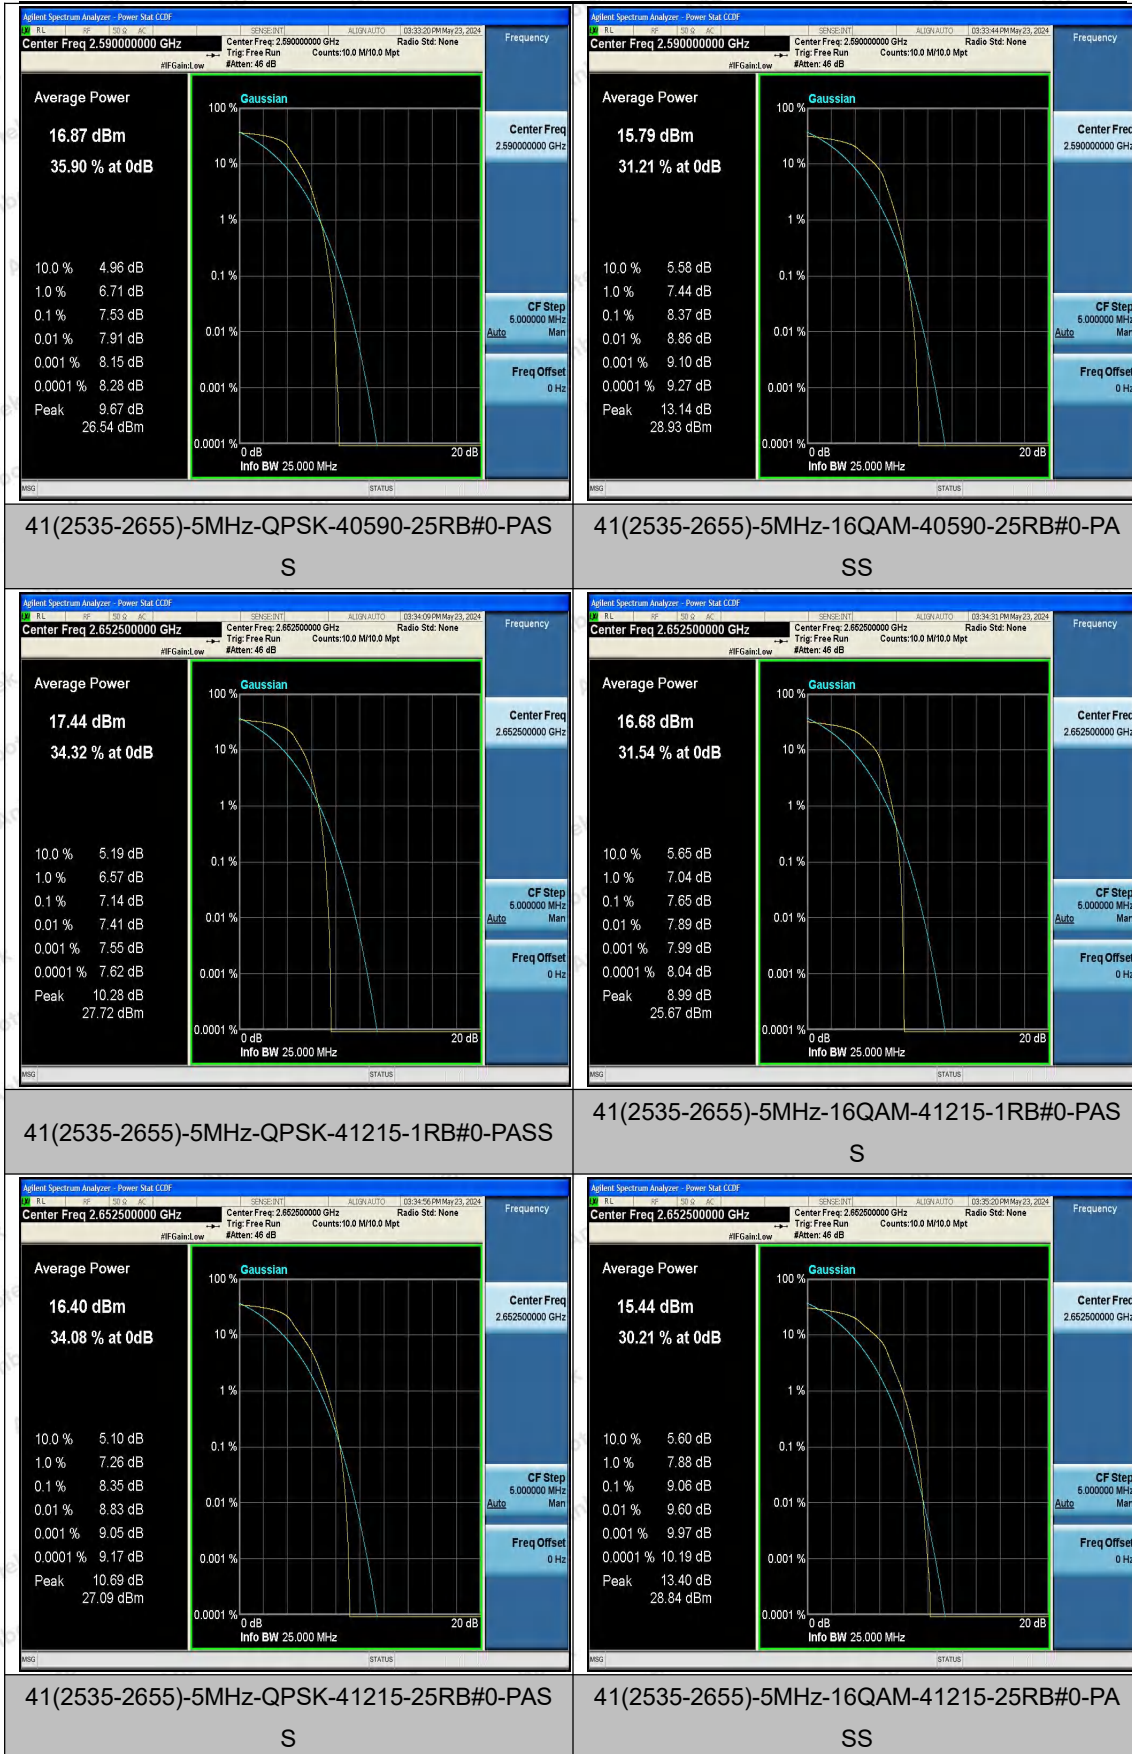

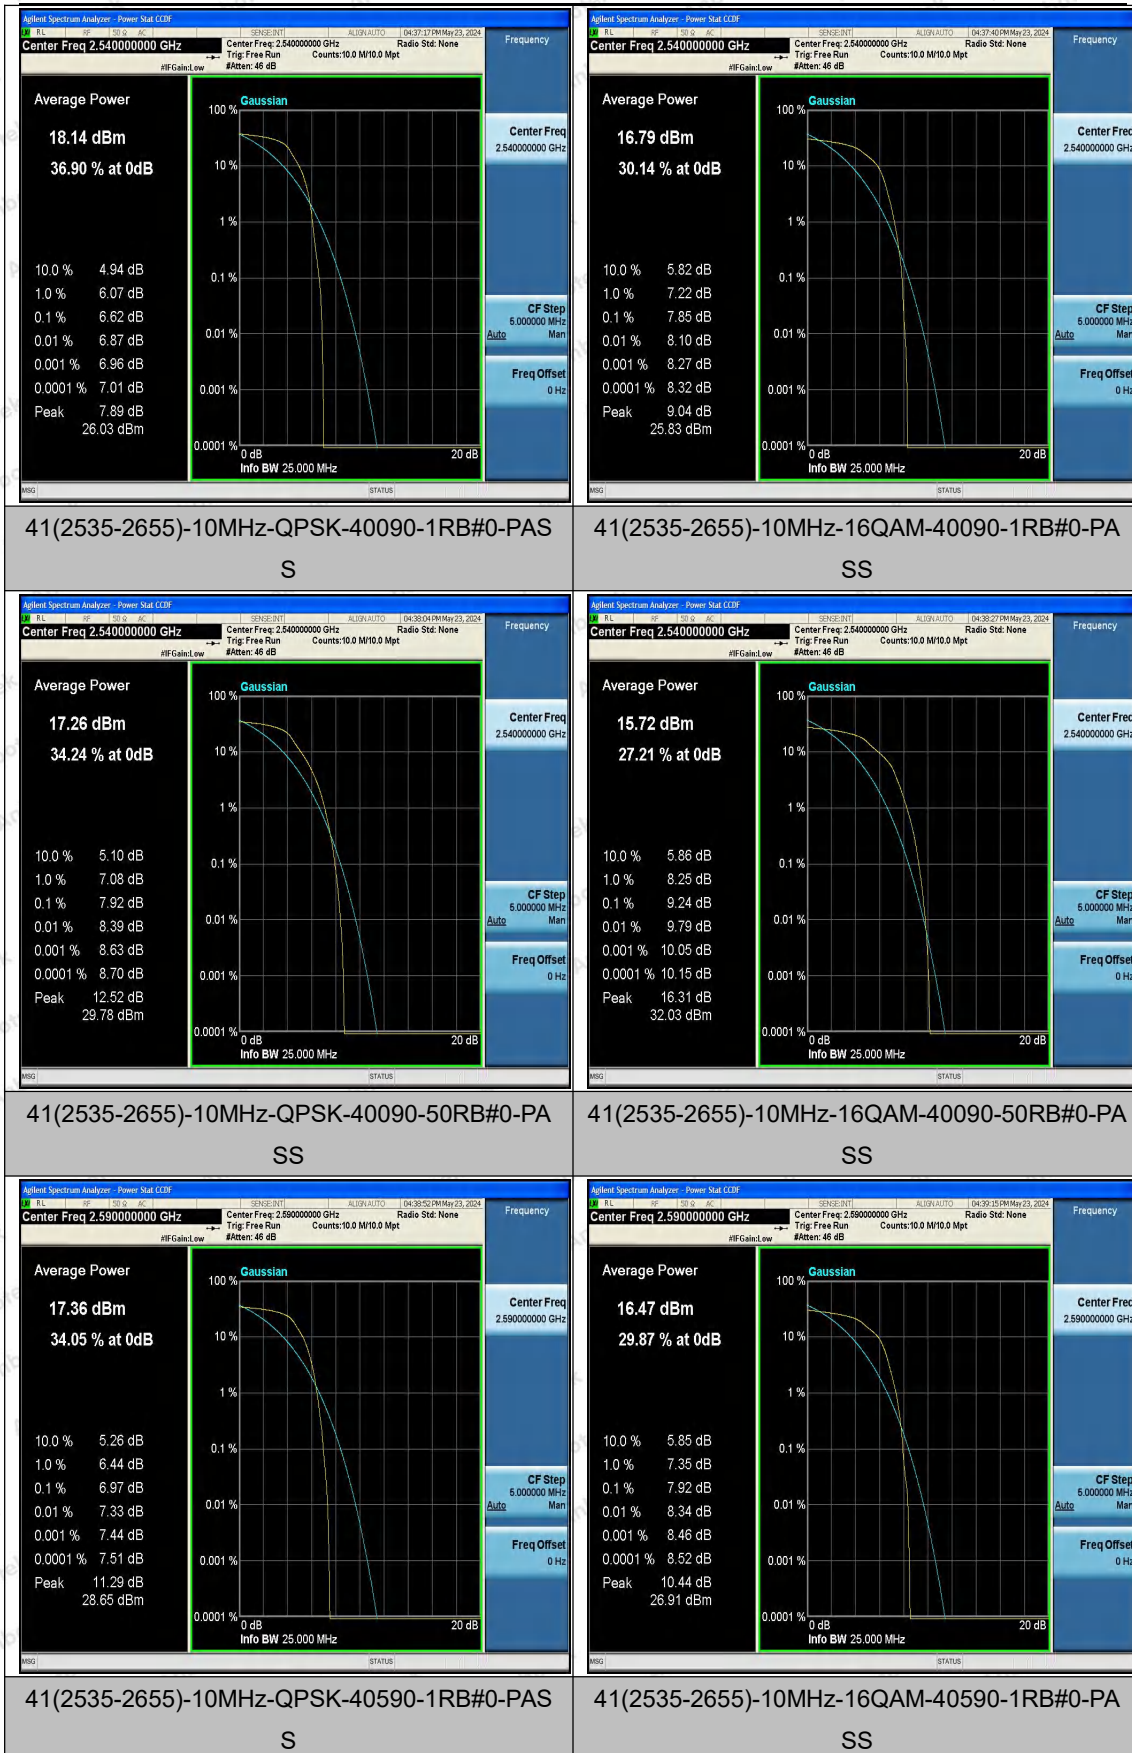

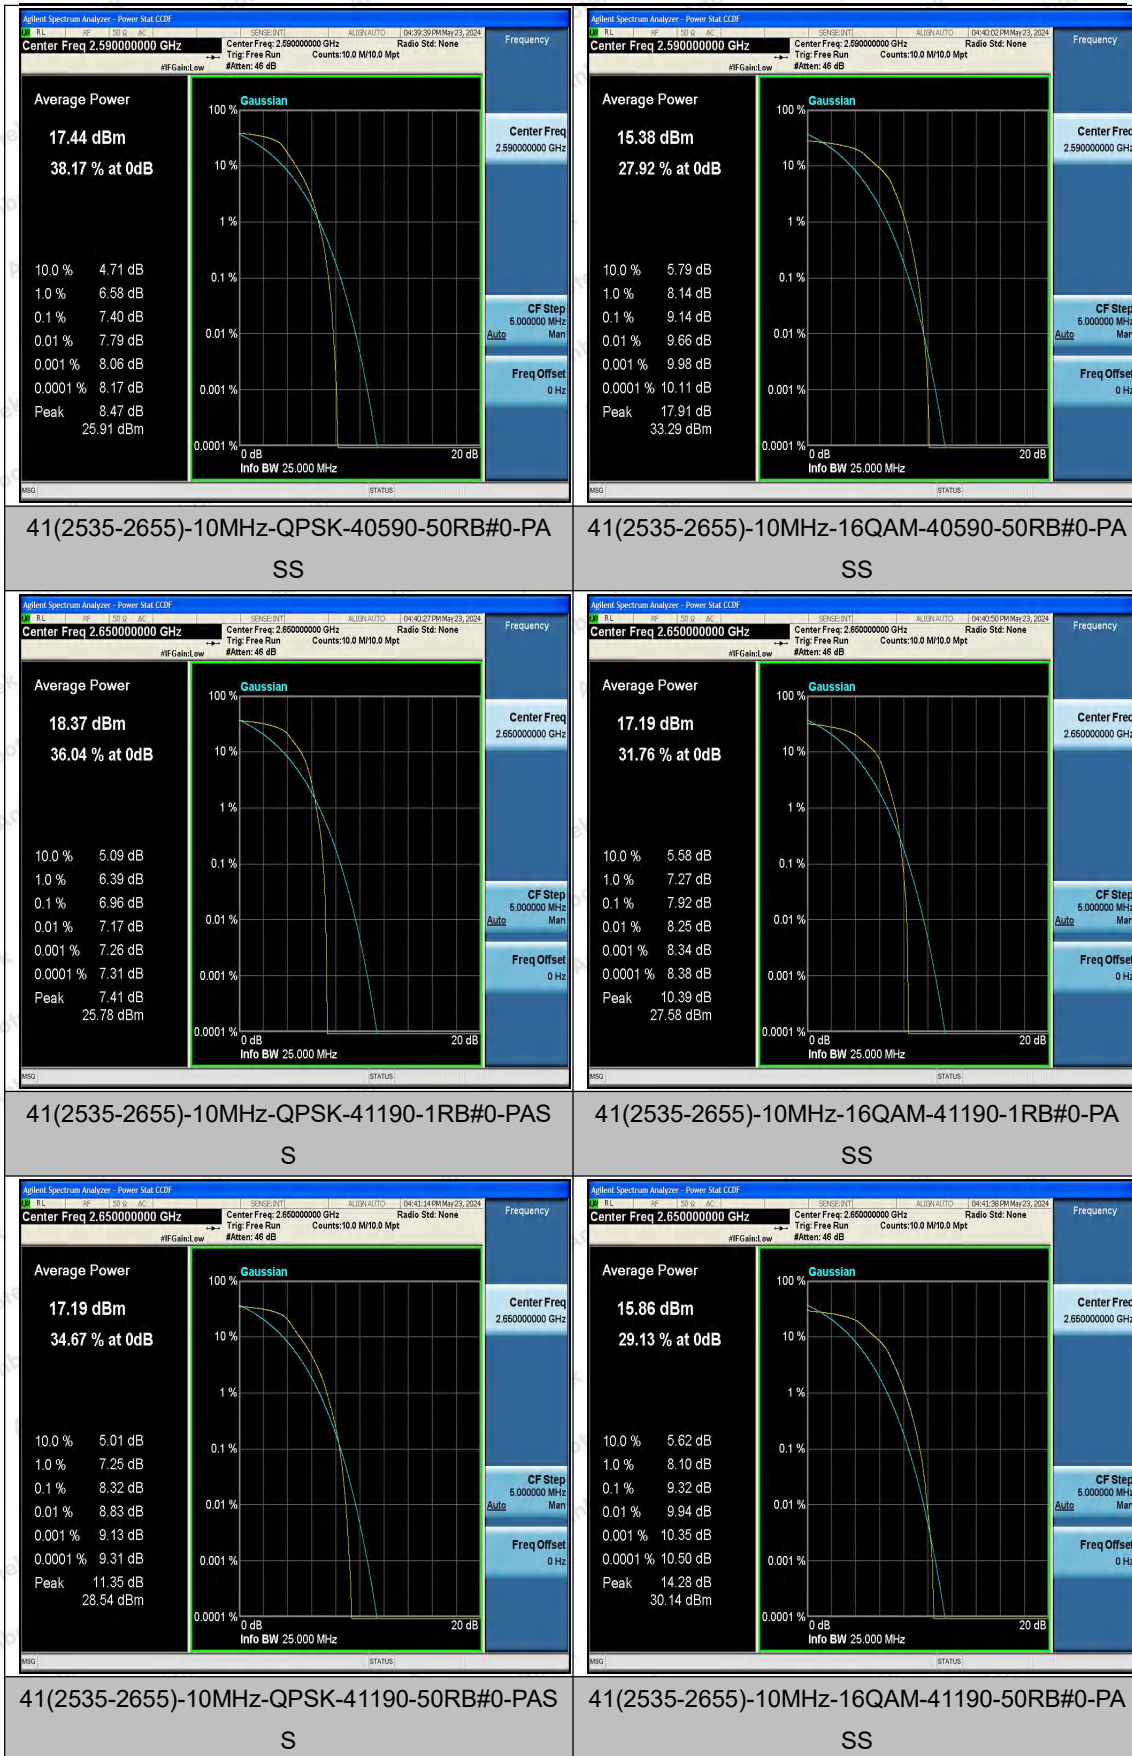


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



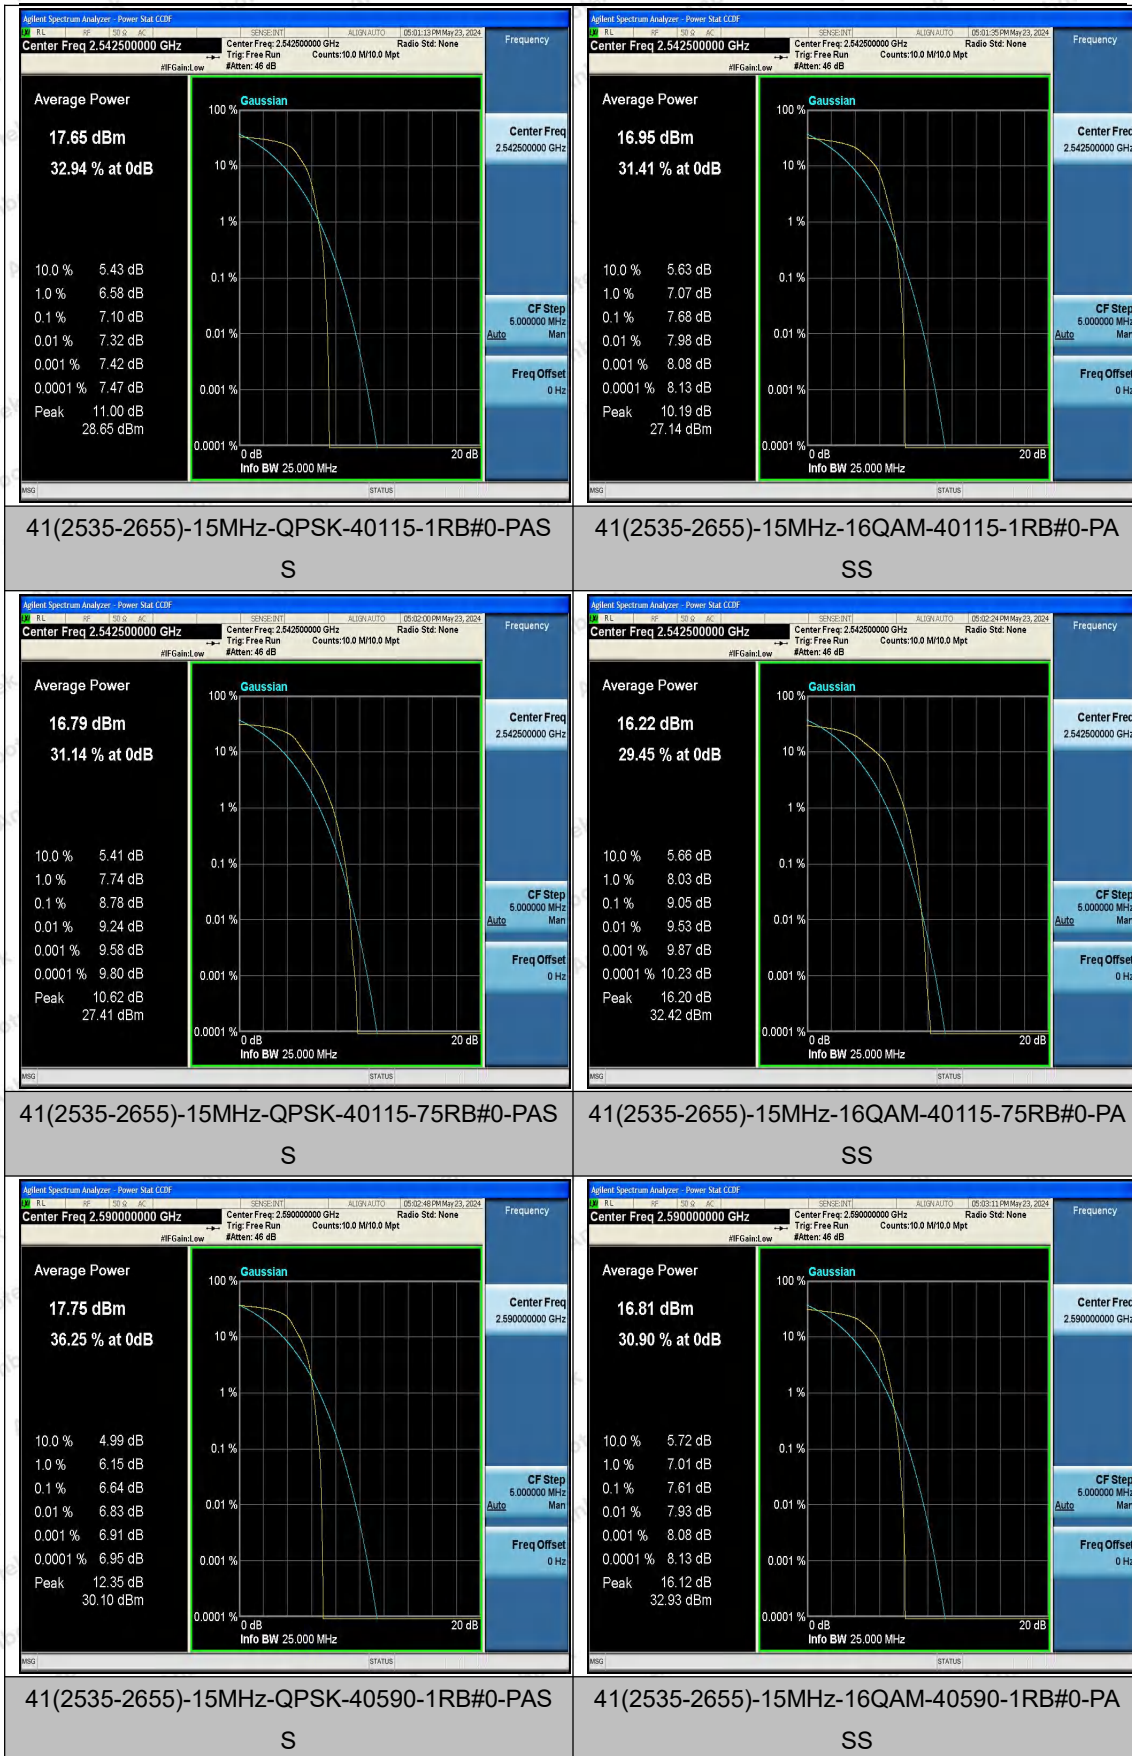


Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com




Hotline
400-003-0500
www.anbotek.com.cn



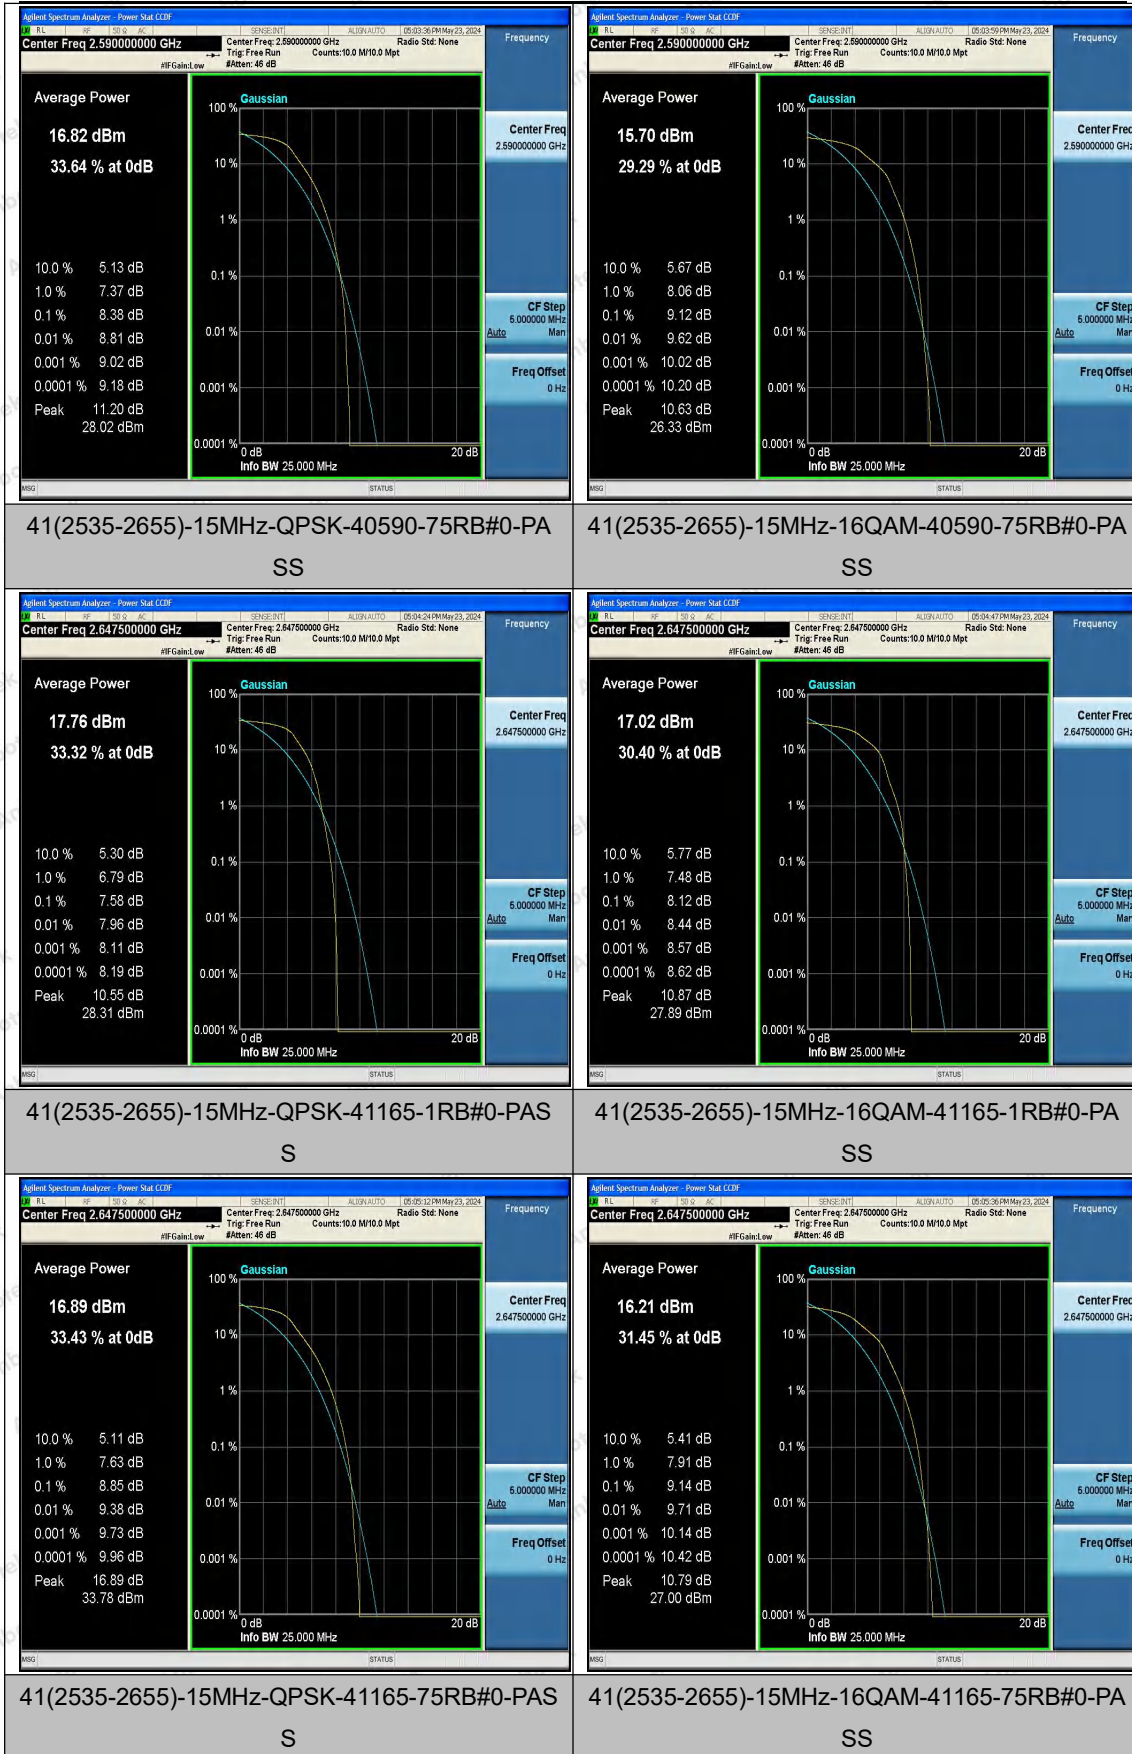

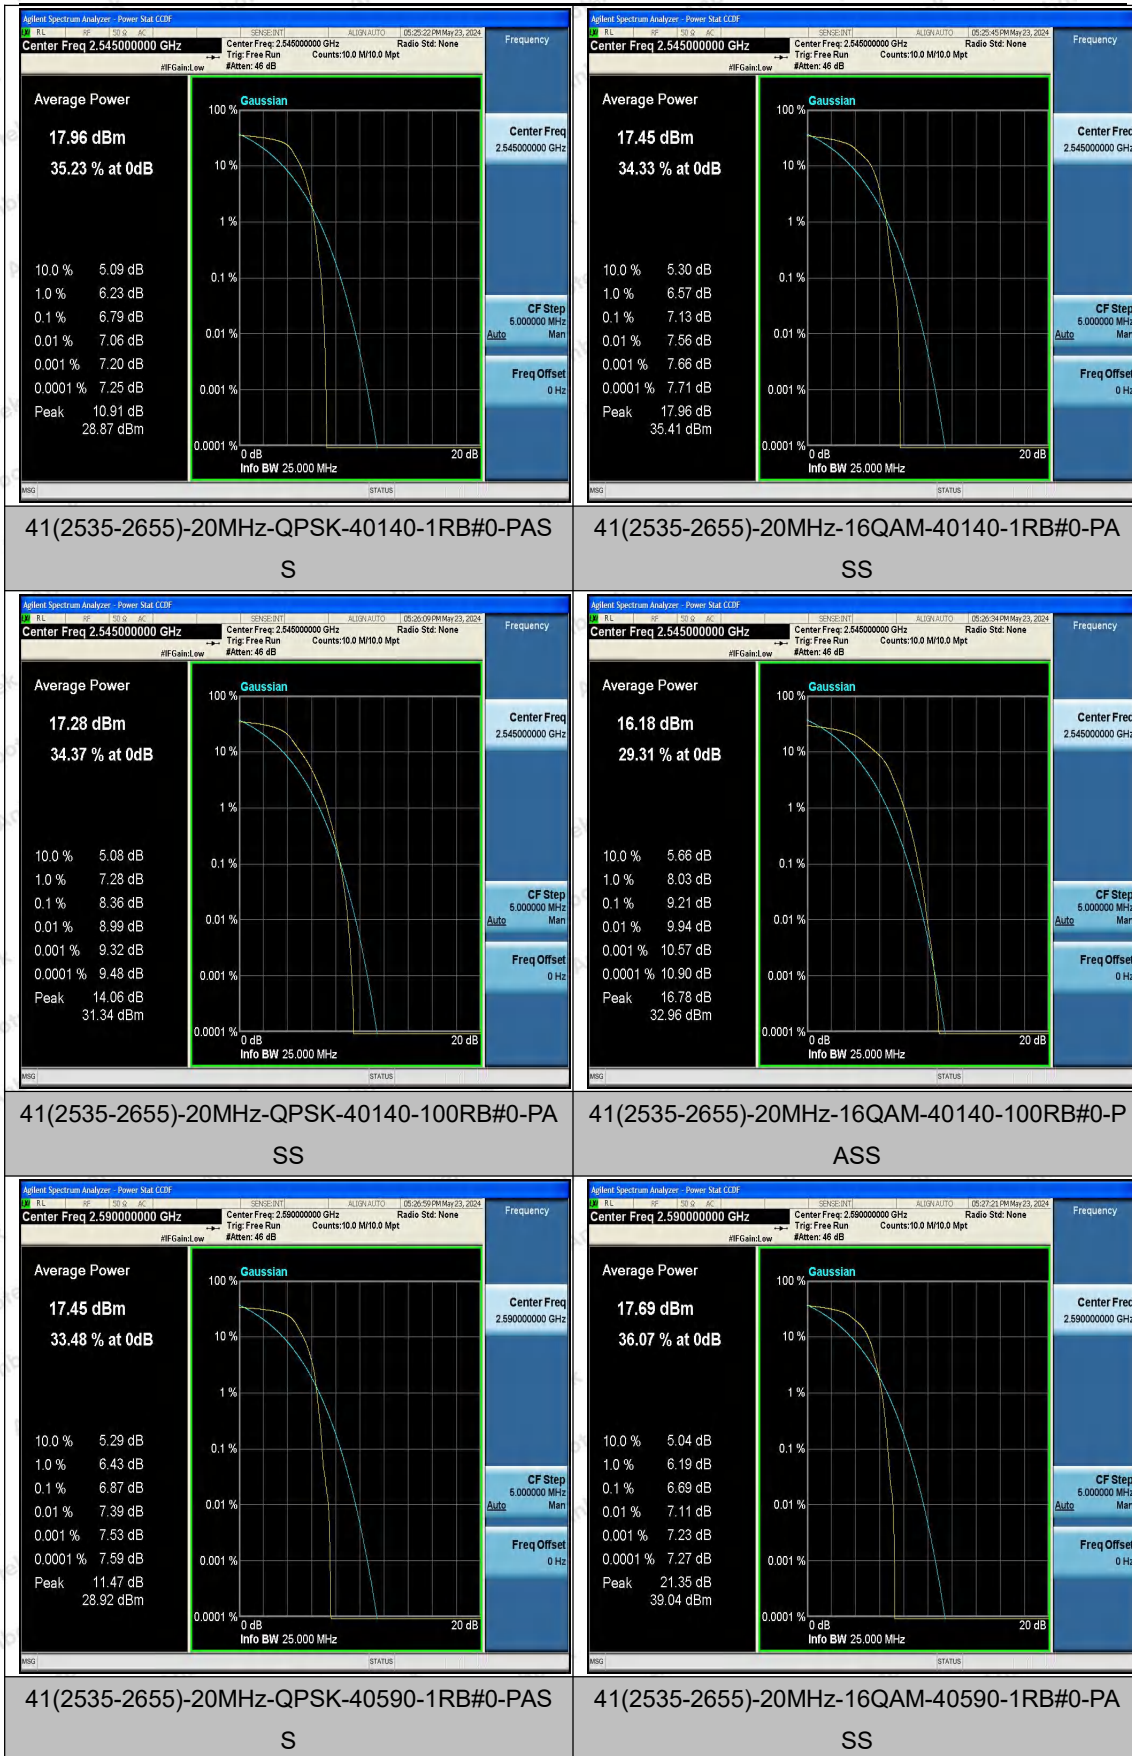

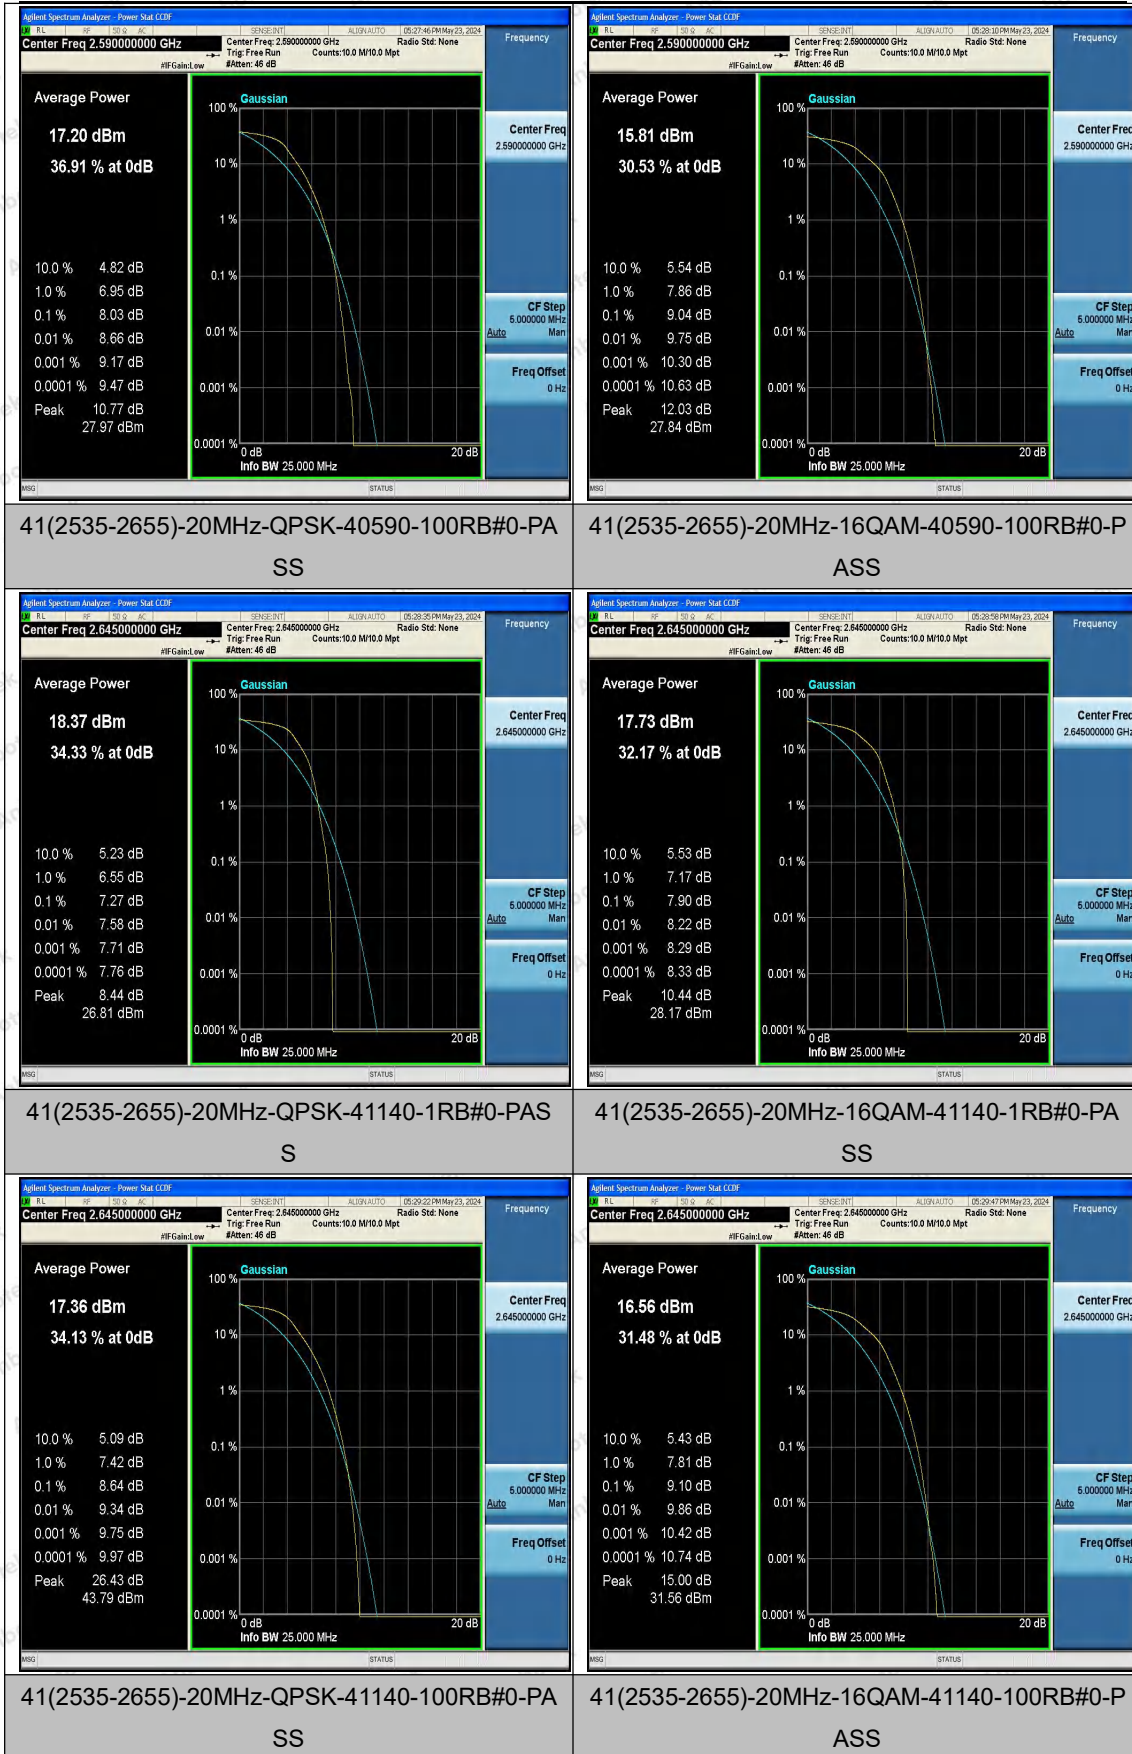


Appendix C: 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
41(2535-2655)	5MHz	QPSK	40065	25RB#0	4.5046	5.014	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	4.5039	5.042	PASS
41(2535-2655)	5MHz	QPSK	40590	25RB#0	4.5244	5.046	PASS
41(2535-2655)	5MHz	16QAM	40590	25RB#0	4.5191	5.061	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	4.5039	4.985	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	4.5173	5.045	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	9.0217	10.03	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	8.9992	9.861	PASS
41(2535-2655)	10MHz	QPSK	40590	50RB#0	9.0014	9.989	PASS
41(2535-2655)	10MHz	16QAM	40590	50RB#0	8.9958	9.947	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	9.0152	9.979	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	8.9432	9.826	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	13.516	14.68	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	13.473	14.85	PASS
41(2535-2655)	15MHz	QPSK	40590	75RB#0	13.464	14.80	PASS
41(2535-2655)	15MHz	16QAM	40590	75RB#0	13.530	14.78	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	13.400	14.83	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	13.528	14.64	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	17.983	19.42	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	17.911	19.46	PASS
41(2535-2655)	20MHz	QPSK	40590	100RB#0	17.996	20.06	PASS
41(2535-2655)	20MHz	16QAM	40590	100RB#0	17.995	19.67	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	17.956	19.56	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	17.968	19.36	PASS



Test Graphs

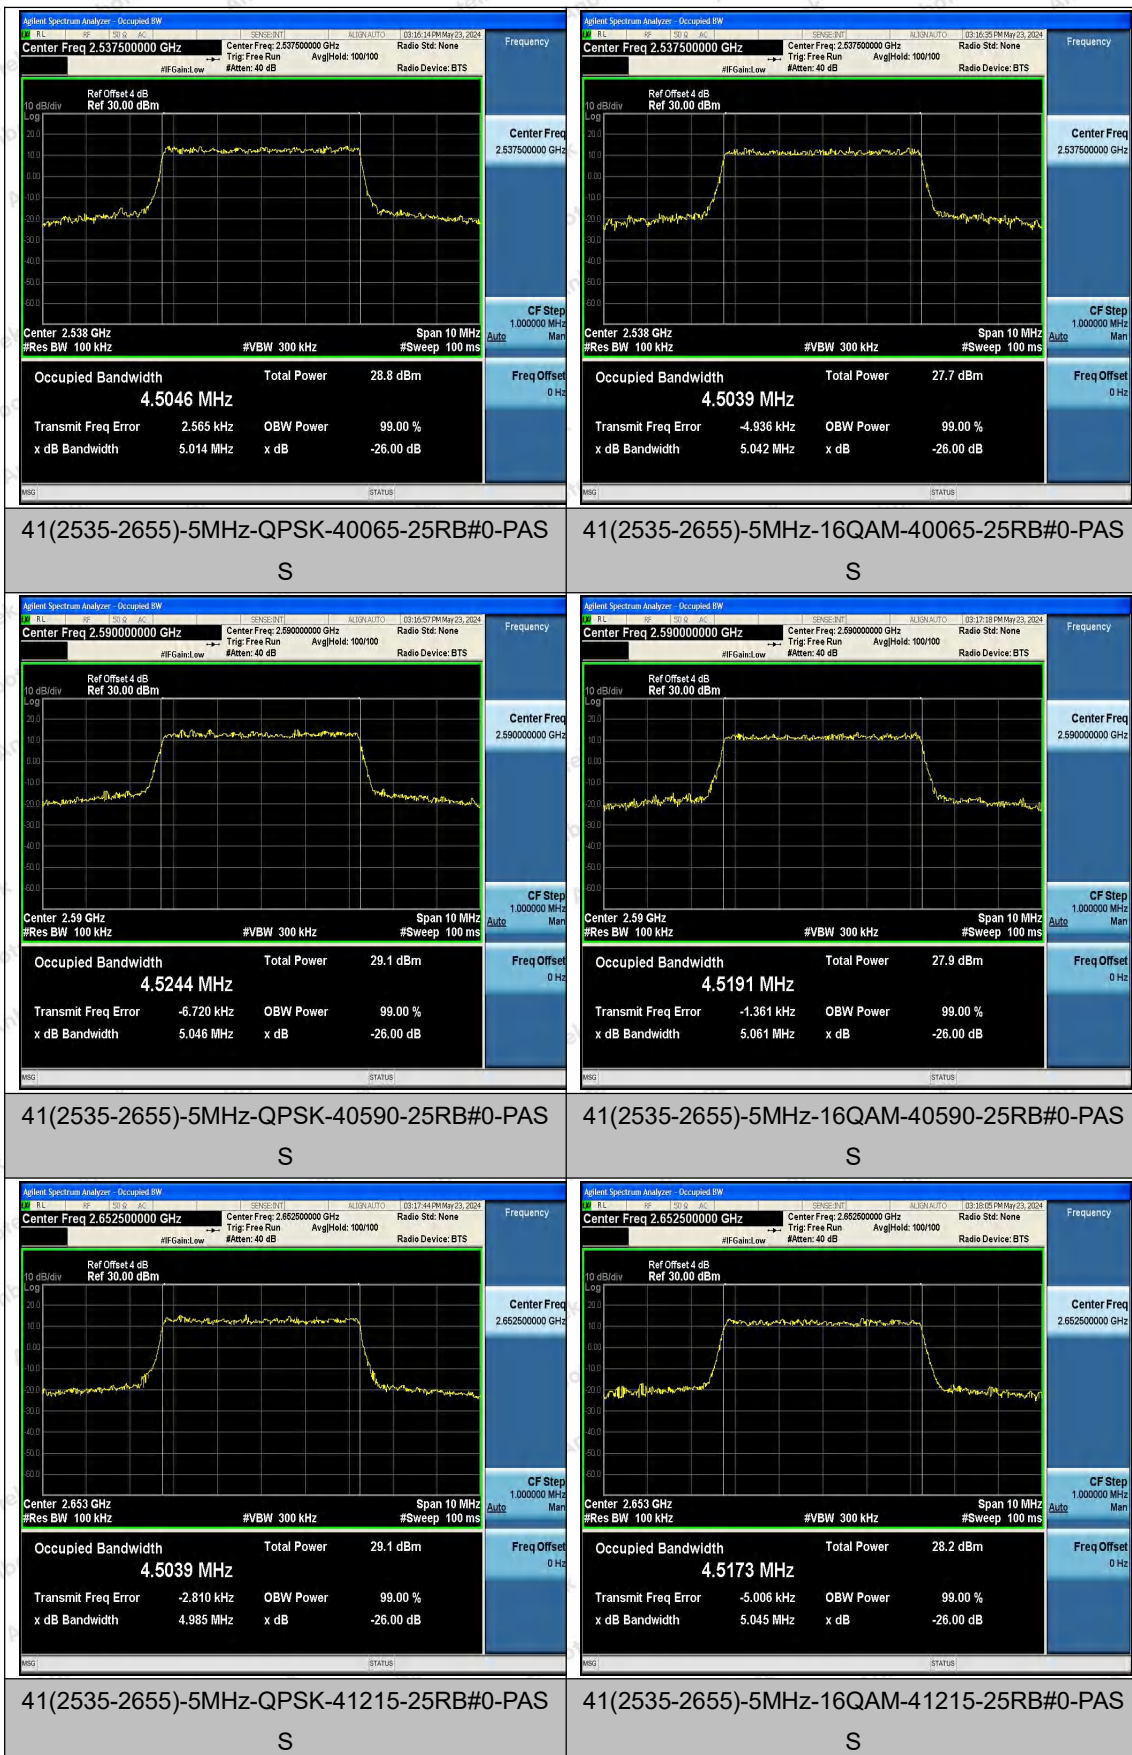


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



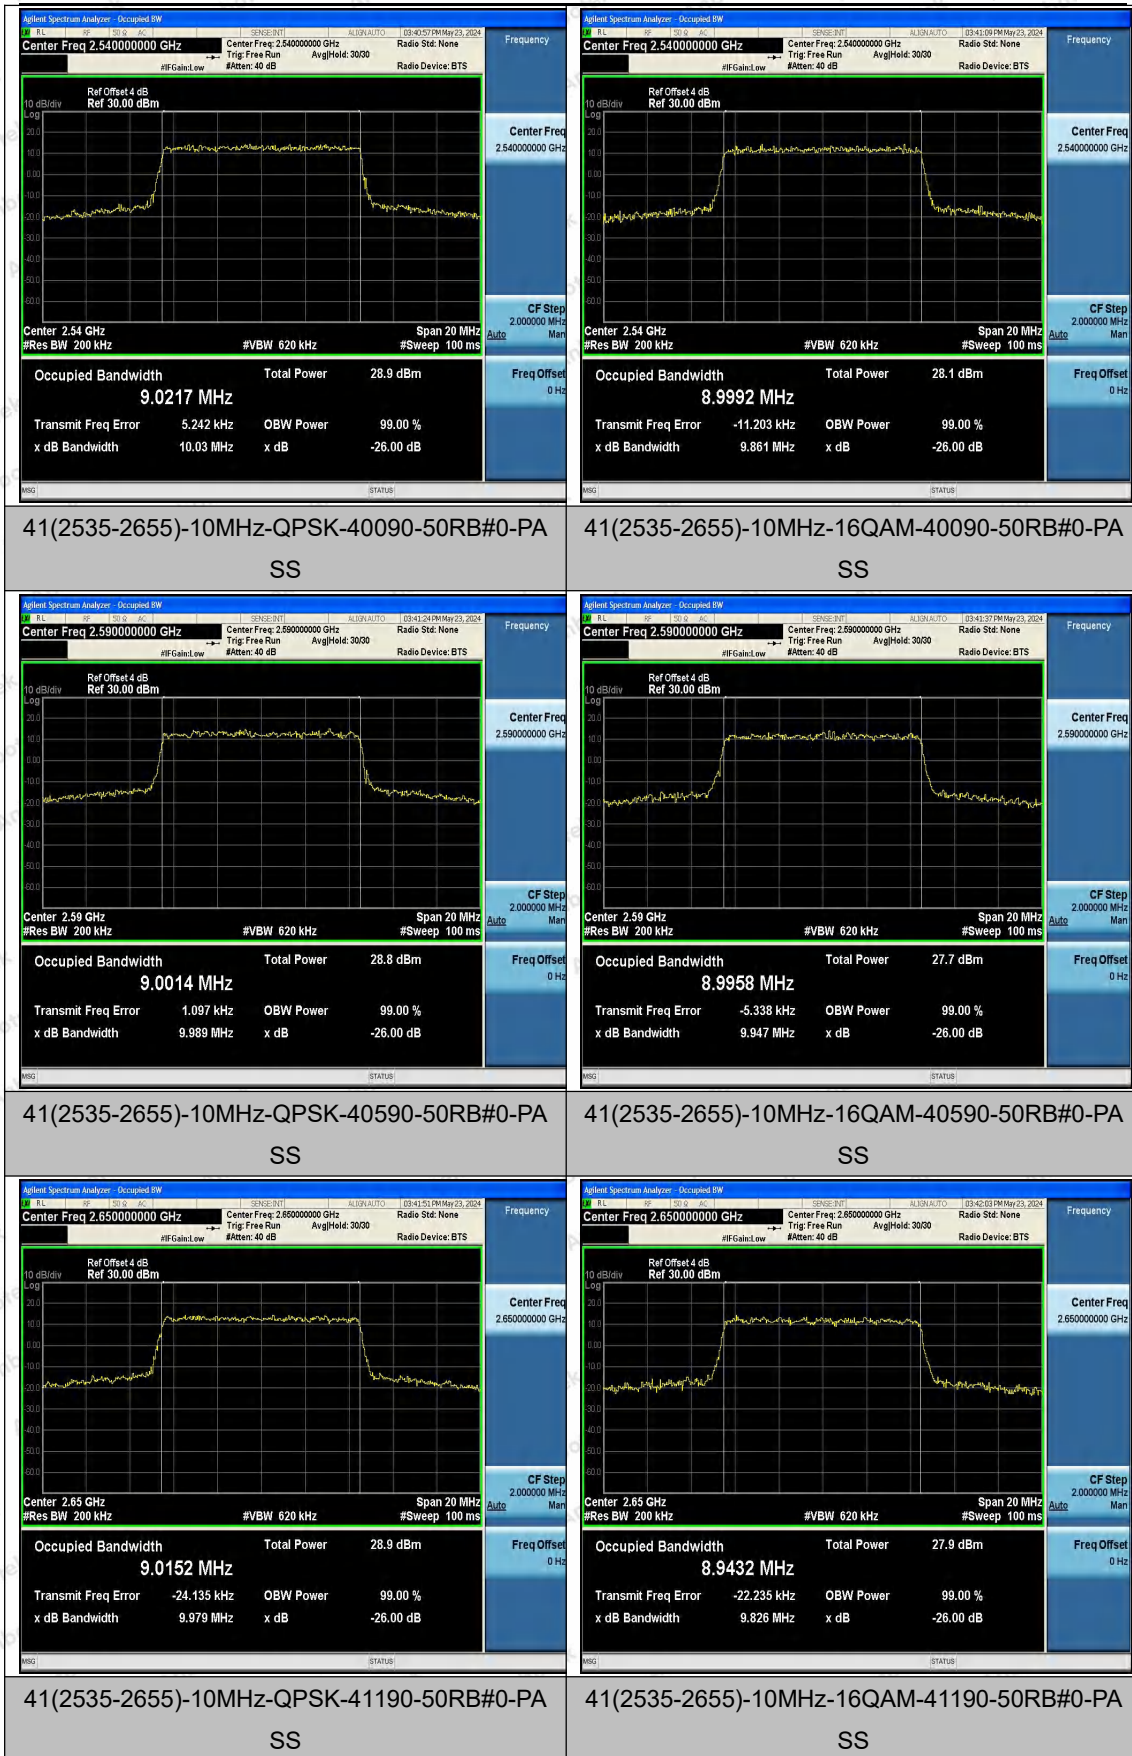


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



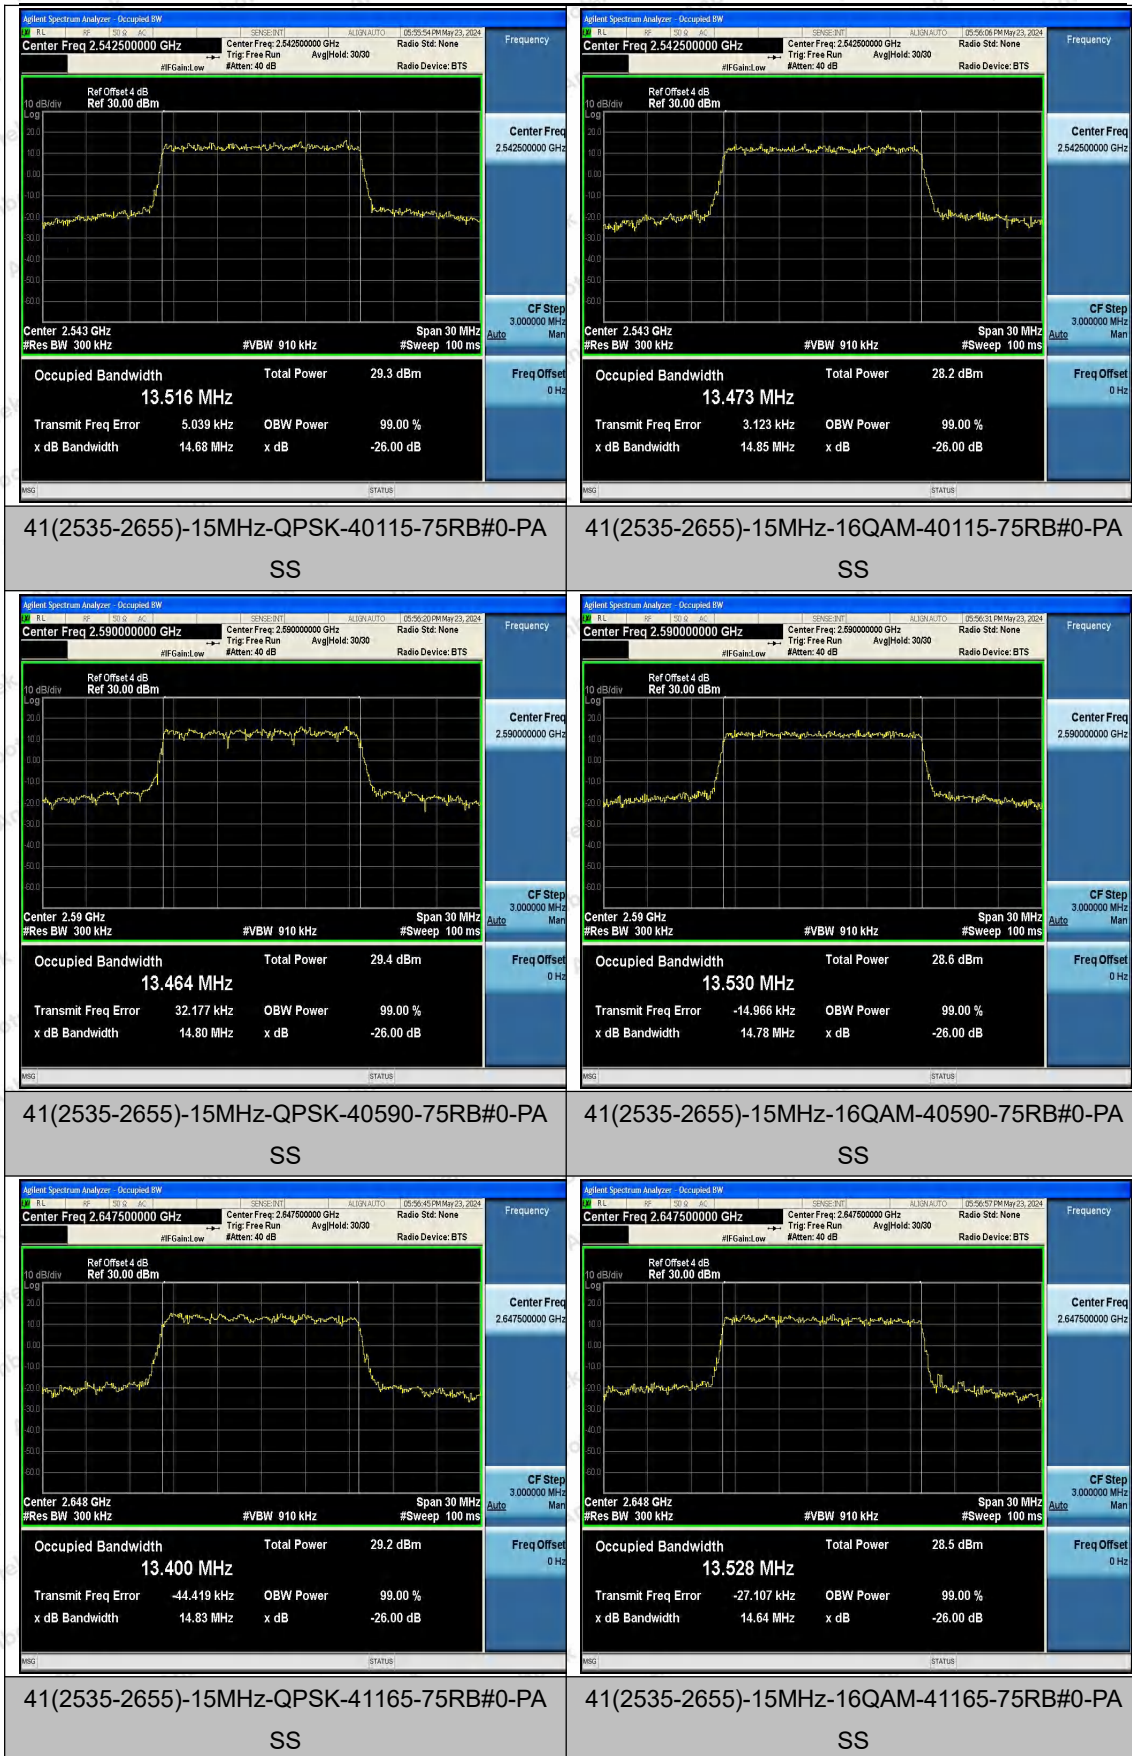


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



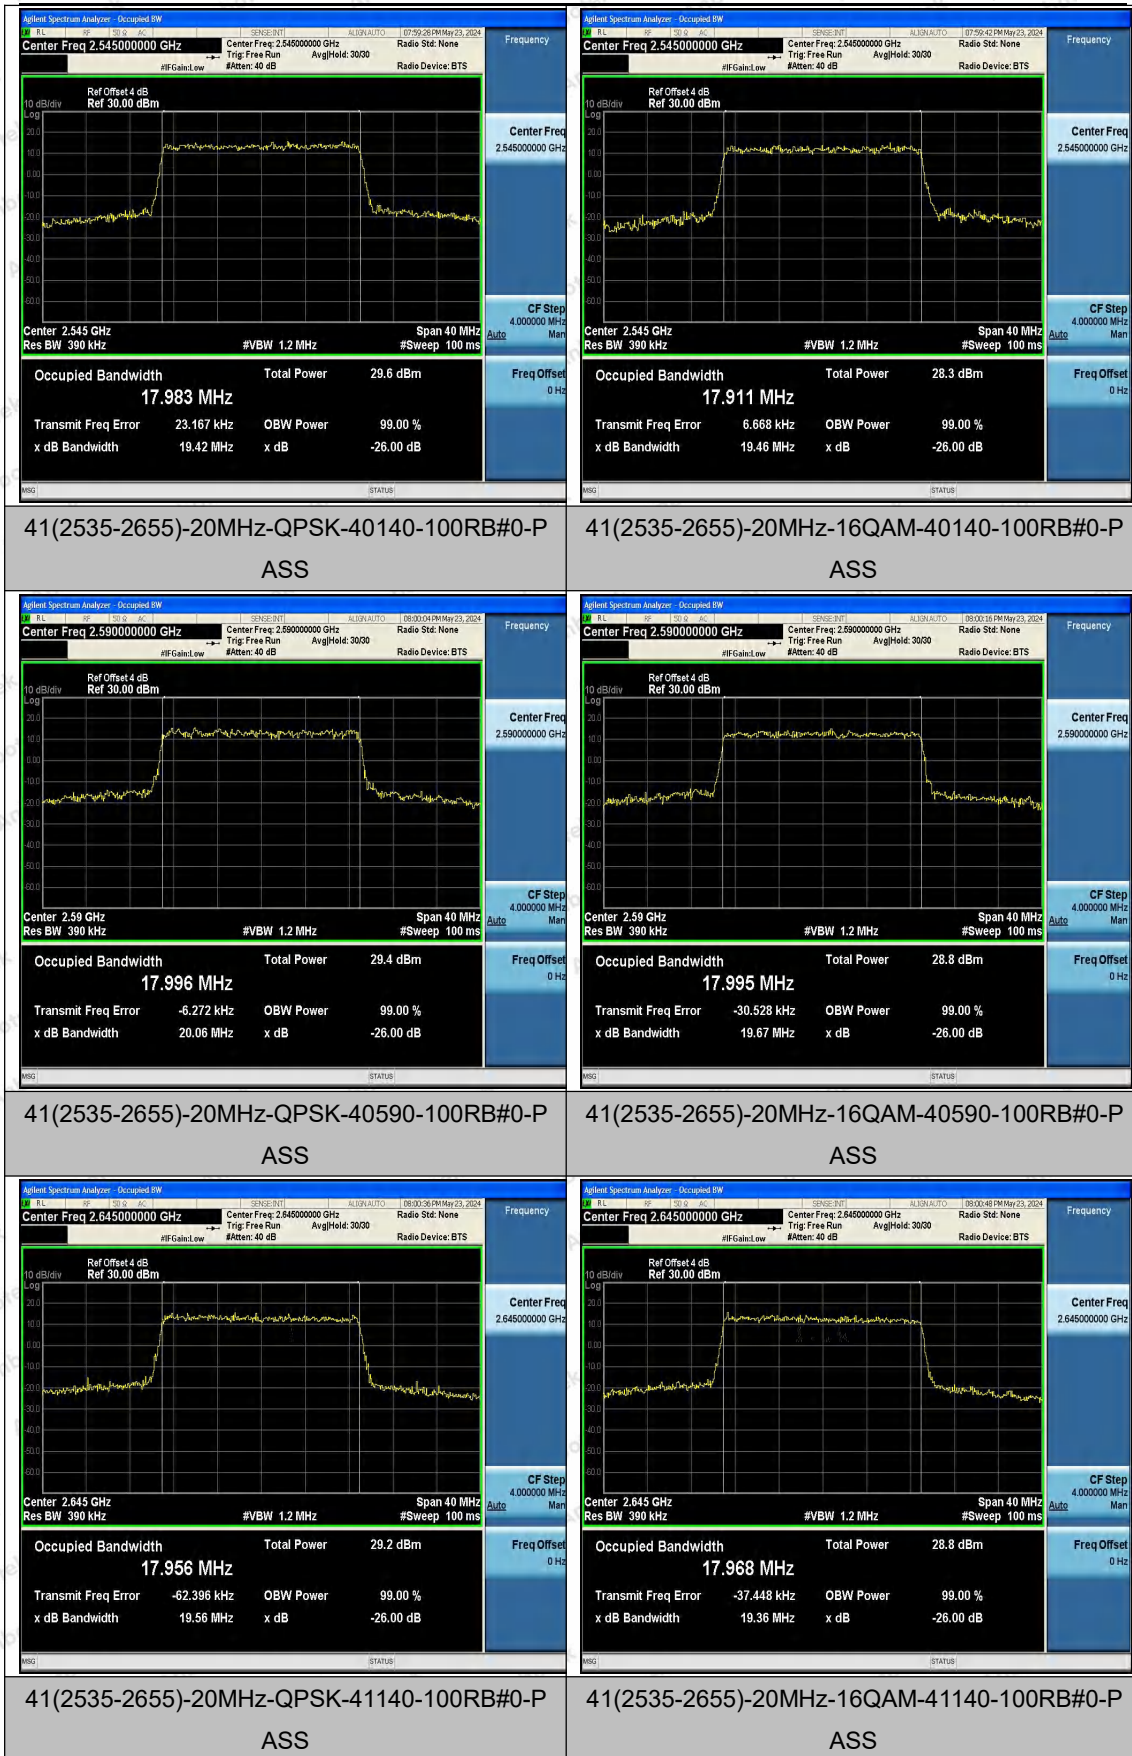

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix D: Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	1RB#0	-20.36	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	-19.30	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#24	-37.15	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#24	-36.30	PASS
41(2535-2655)	5MHz	QPSK	40065	25RB#0	-29.96	PASS
41(2535-2655)	5MHz	16QAM	40065	25RB#0	-32.06	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	-32.65	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	-32.80	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#24	-13.33	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#24	-16.06	PASS
41(2535-2655)	5MHz	QPSK	41215	25RB#0	-28.90	PASS
41(2535-2655)	5MHz	16QAM	41215	25RB#0	-30.16	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	-31.71	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	-23.92	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#49	-36.27	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#49	-35.10	PASS
41(2535-2655)	10MHz	QPSK	40090	50RB#0	-31.69	PASS
41(2535-2655)	10MHz	16QAM	40090	50RB#0	-34.14	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	-30.24	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	-30.43	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#49	-16.64	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#49	-20.51	PASS
41(2535-2655)	10MHz	QPSK	41190	50RB#0	-28.85	PASS
41(2535-2655)	10MHz	16QAM	41190	50RB#0	-30.19	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	-20.38	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	-20.88	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#74	-33.04	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#74	-33.29	PASS
41(2535-2655)	15MHz	QPSK	40115	75RB#0	-26.64	PASS
41(2535-2655)	15MHz	16QAM	40115	75RB#0	-29.41	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	-29.22	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	-29.44	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#74	-17.35	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#74	-20.50	PASS
41(2535-2655)	15MHz	QPSK	41165	75RB#0	-25.74	PASS
41(2535-2655)	15MHz	16QAM	41165	75RB#0	-28.29	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	-22.87	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



41(2535-2655)	20MHz	16QAM	40140	1RB#0	-26.38	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#99	-35.67	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#99	-35.09	PASS
41(2535-2655)	20MHz	QPSK	40140	100RB#0	-29.40	PASS
41(2535-2655)	20MHz	16QAM	40140	100RB#0	-30.83	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#0	-29.54	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#0	-30.18	PASS
41(2535-2655)	20MHz	QPSK	41140	1RB#99	-20.64	PASS
41(2535-2655)	20MHz	16QAM	41140	1RB#99	-22.79	PASS
41(2535-2655)	20MHz	QPSK	41140	100RB#0	-29.51	PASS
41(2535-2655)	20MHz	16QAM	41140	100RB#0	-30.68	PASS

Shenzhen Anbotek Compliance Laboratory Limited


Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Test Graphs

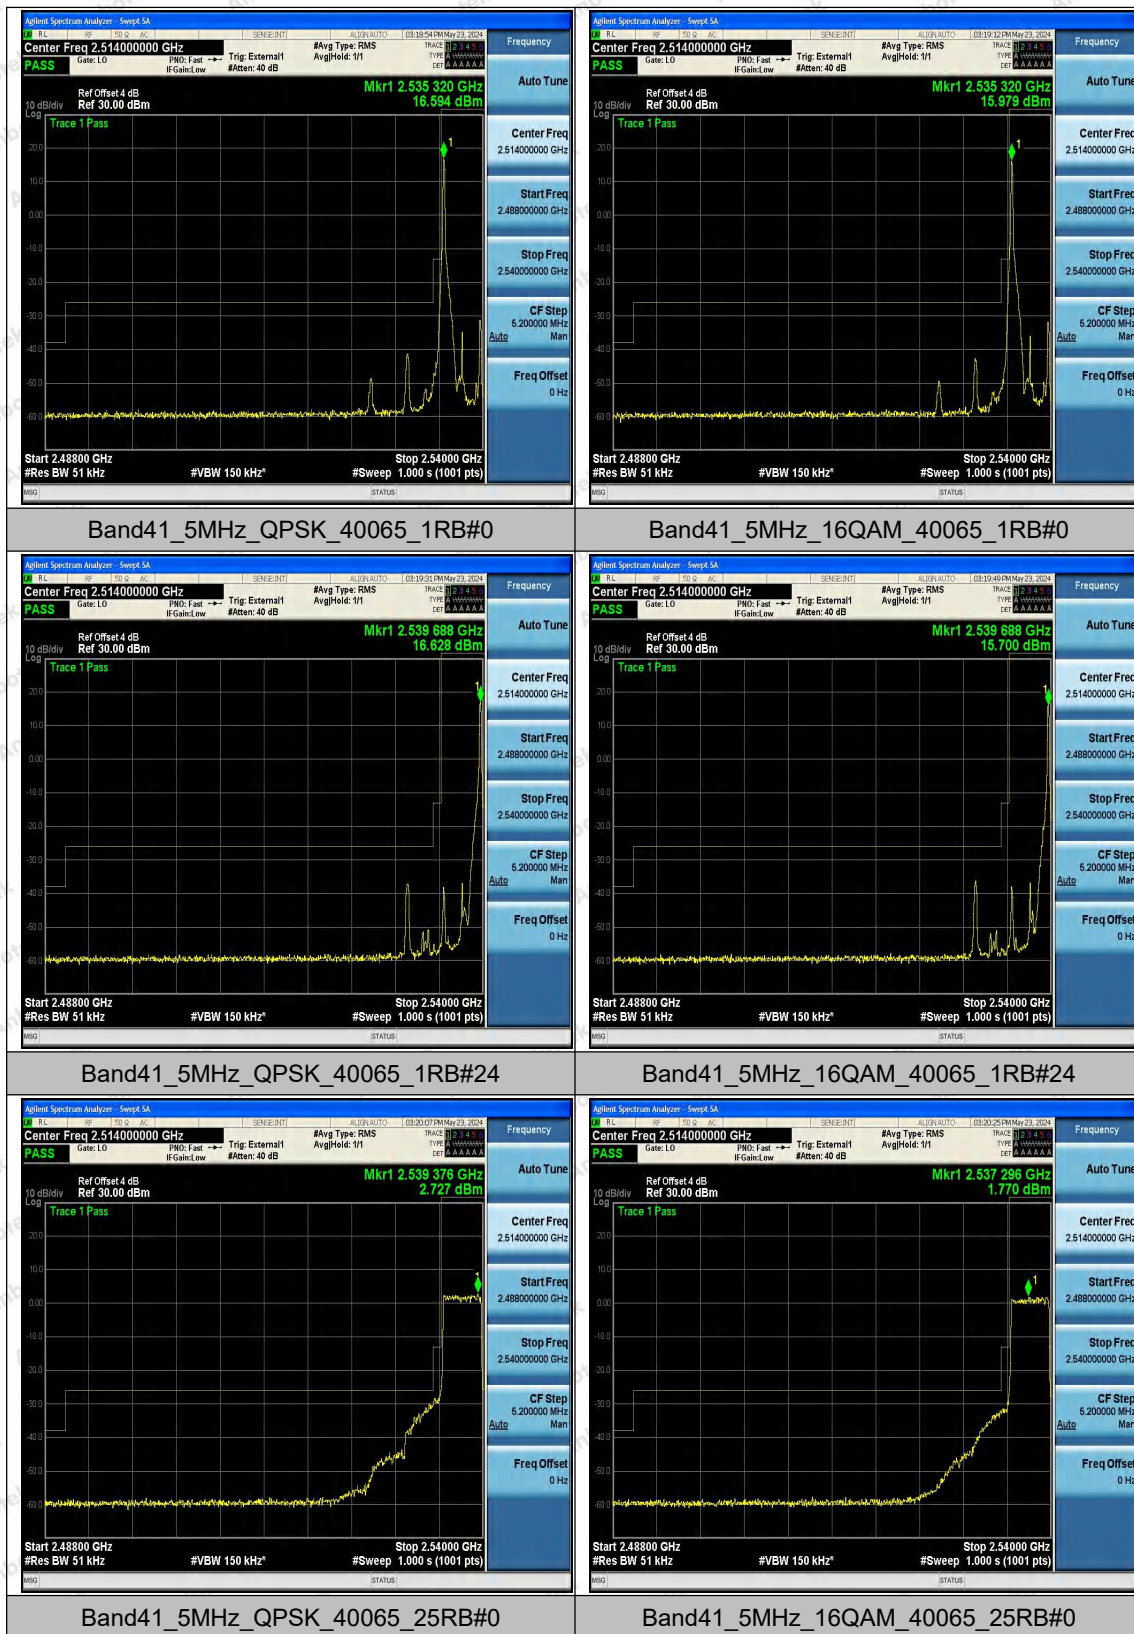


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



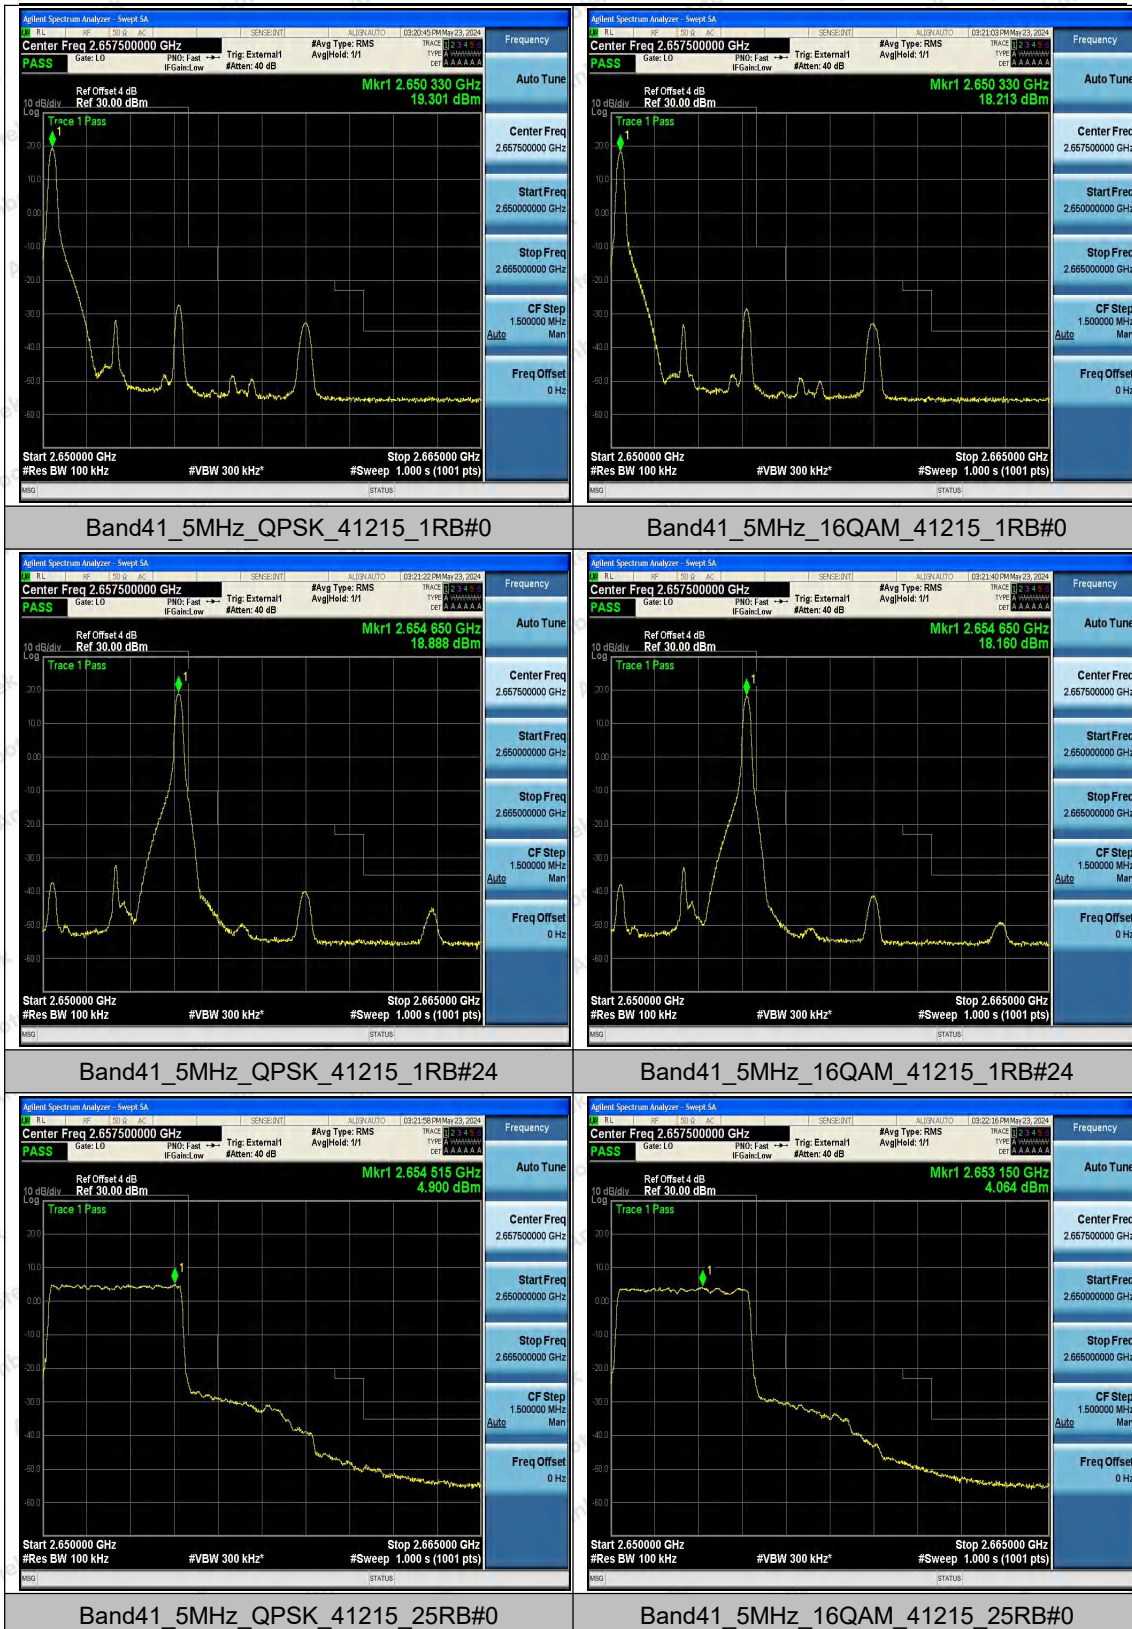


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



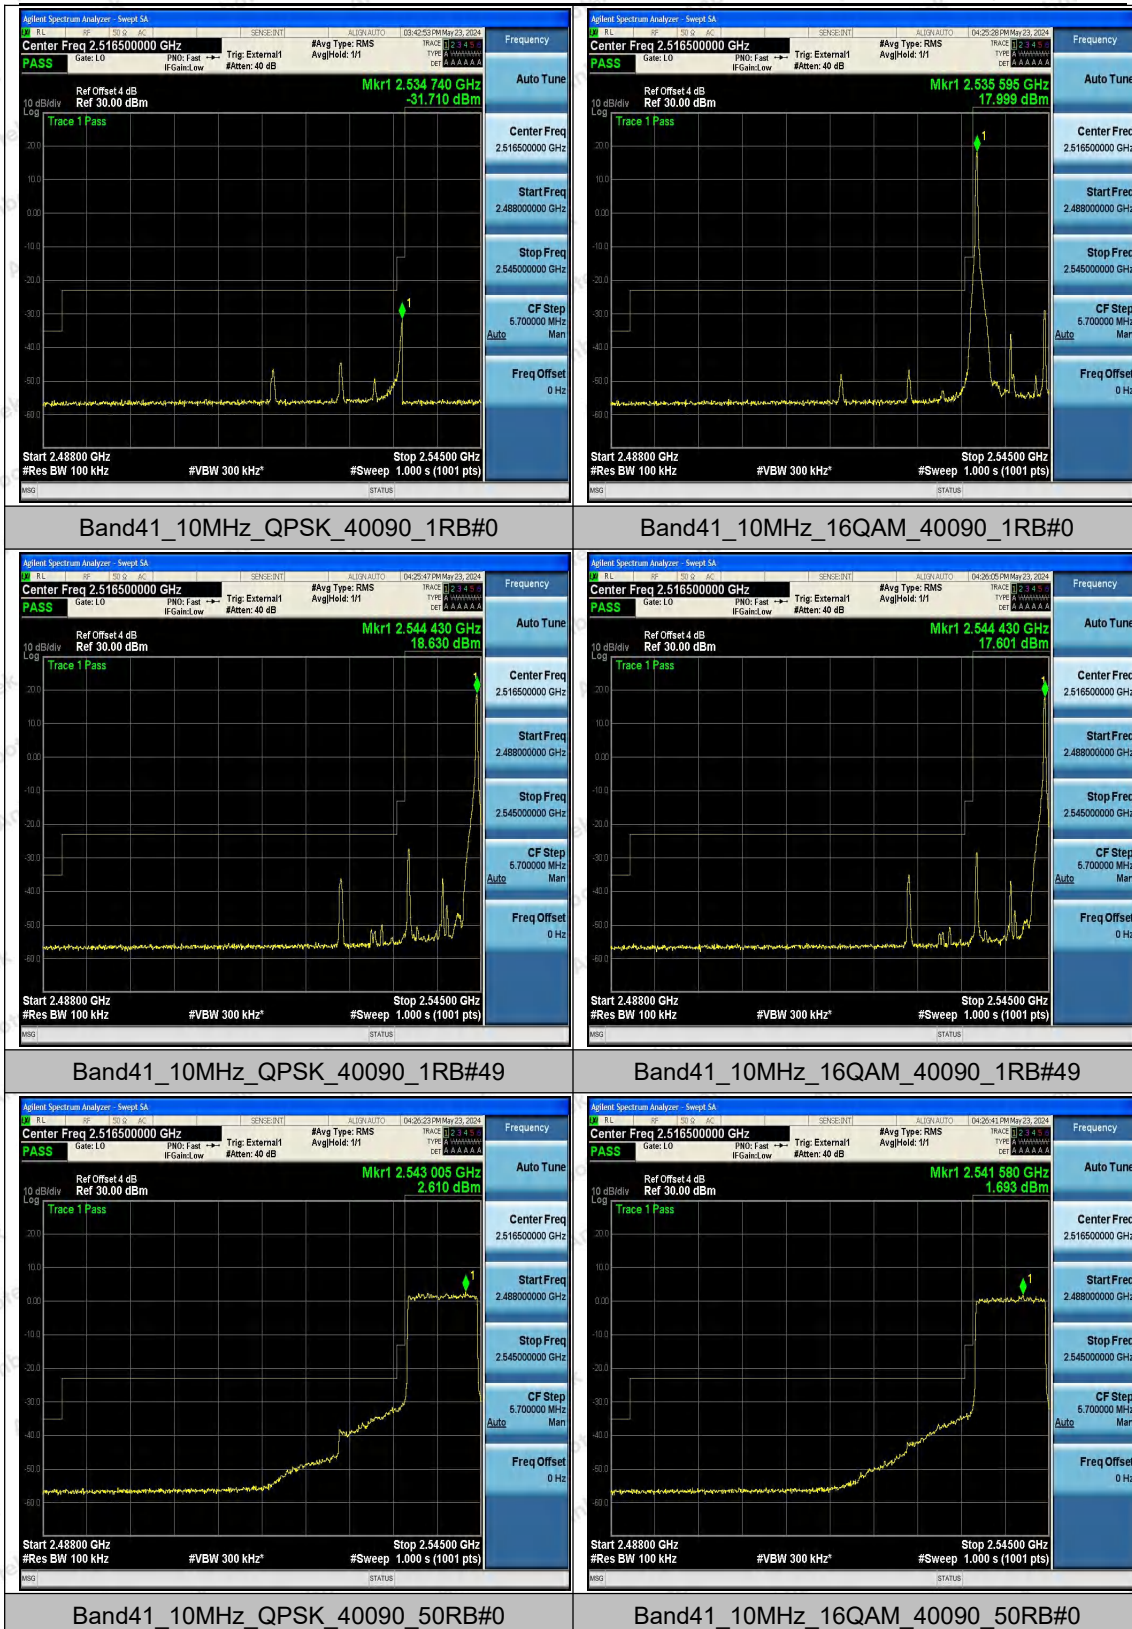


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



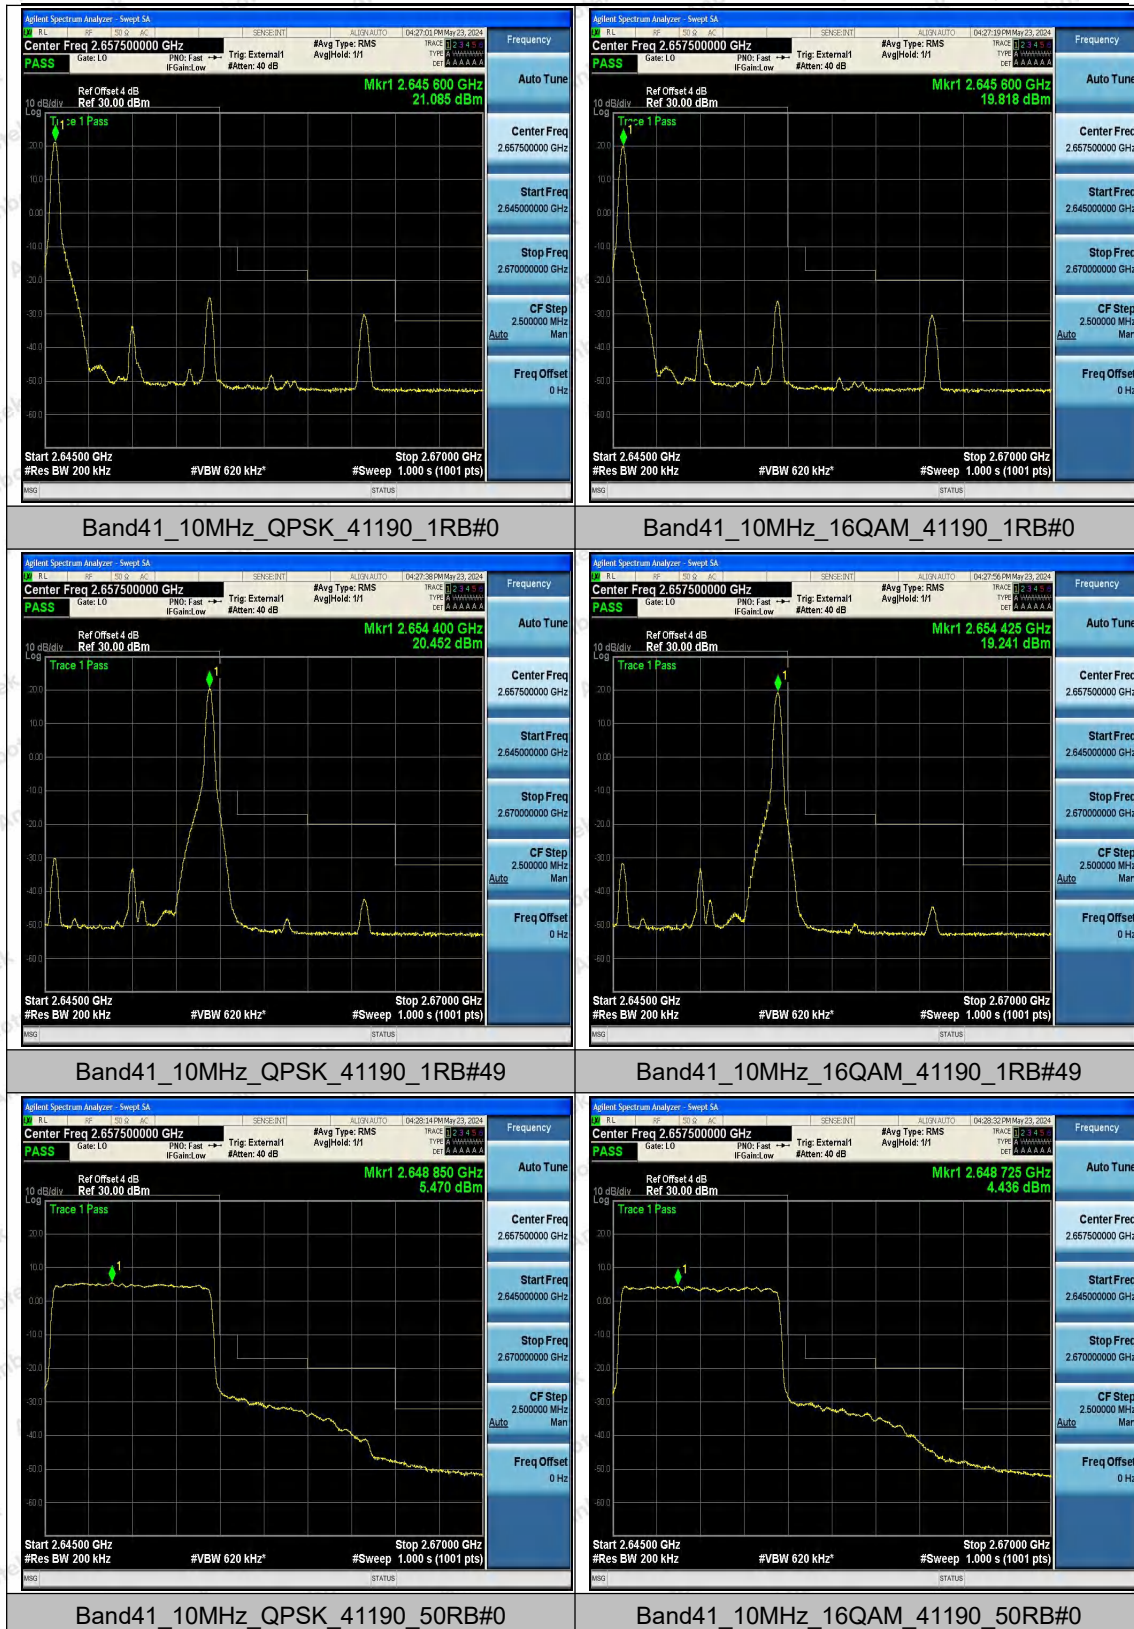


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



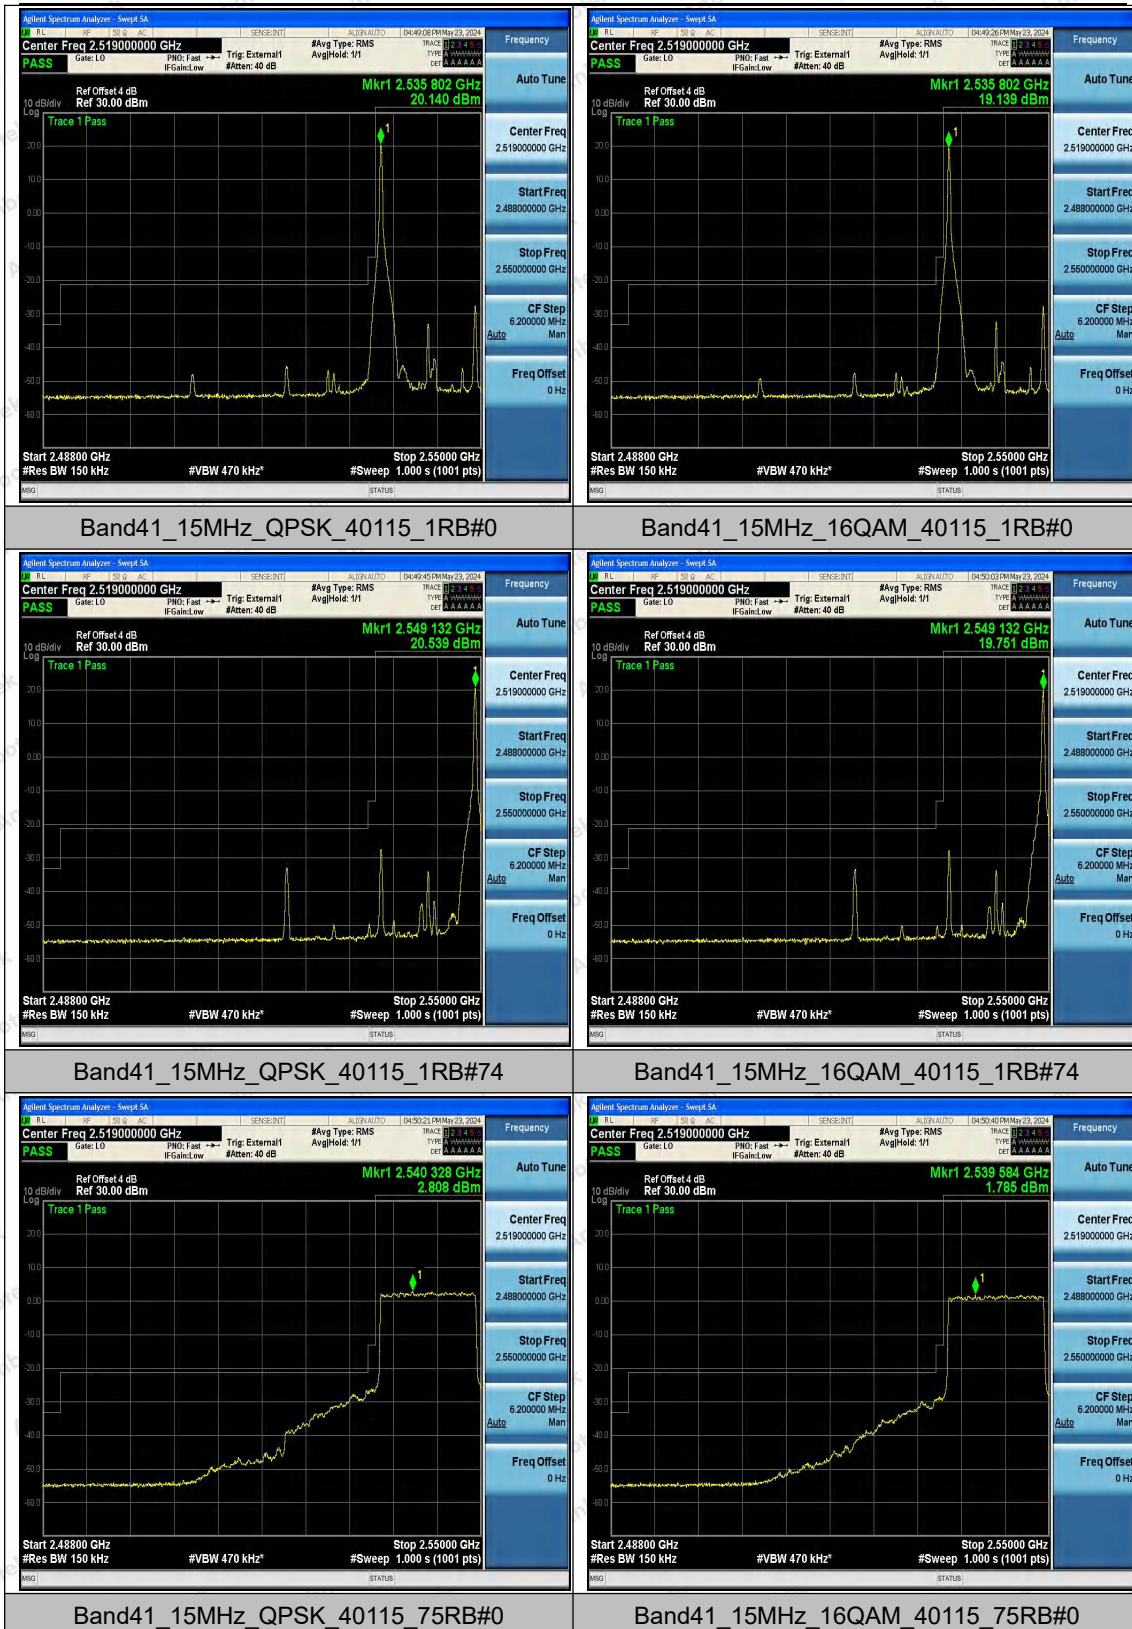


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



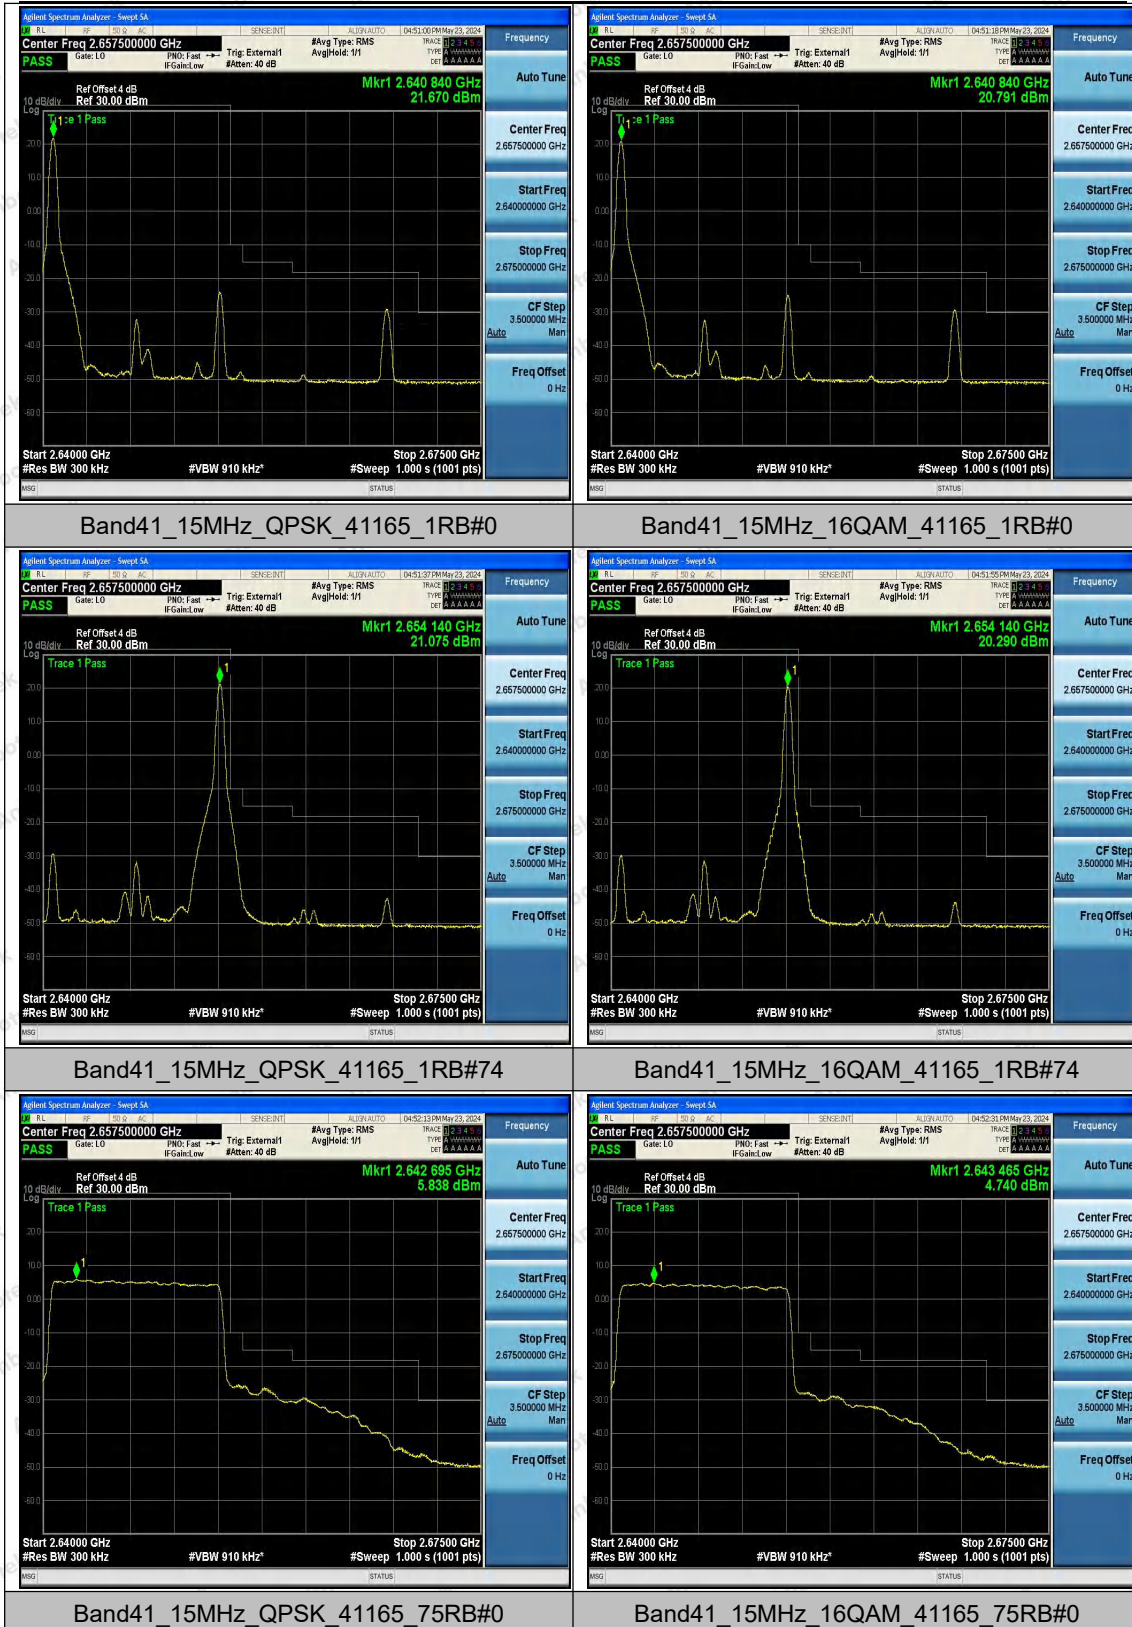


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn



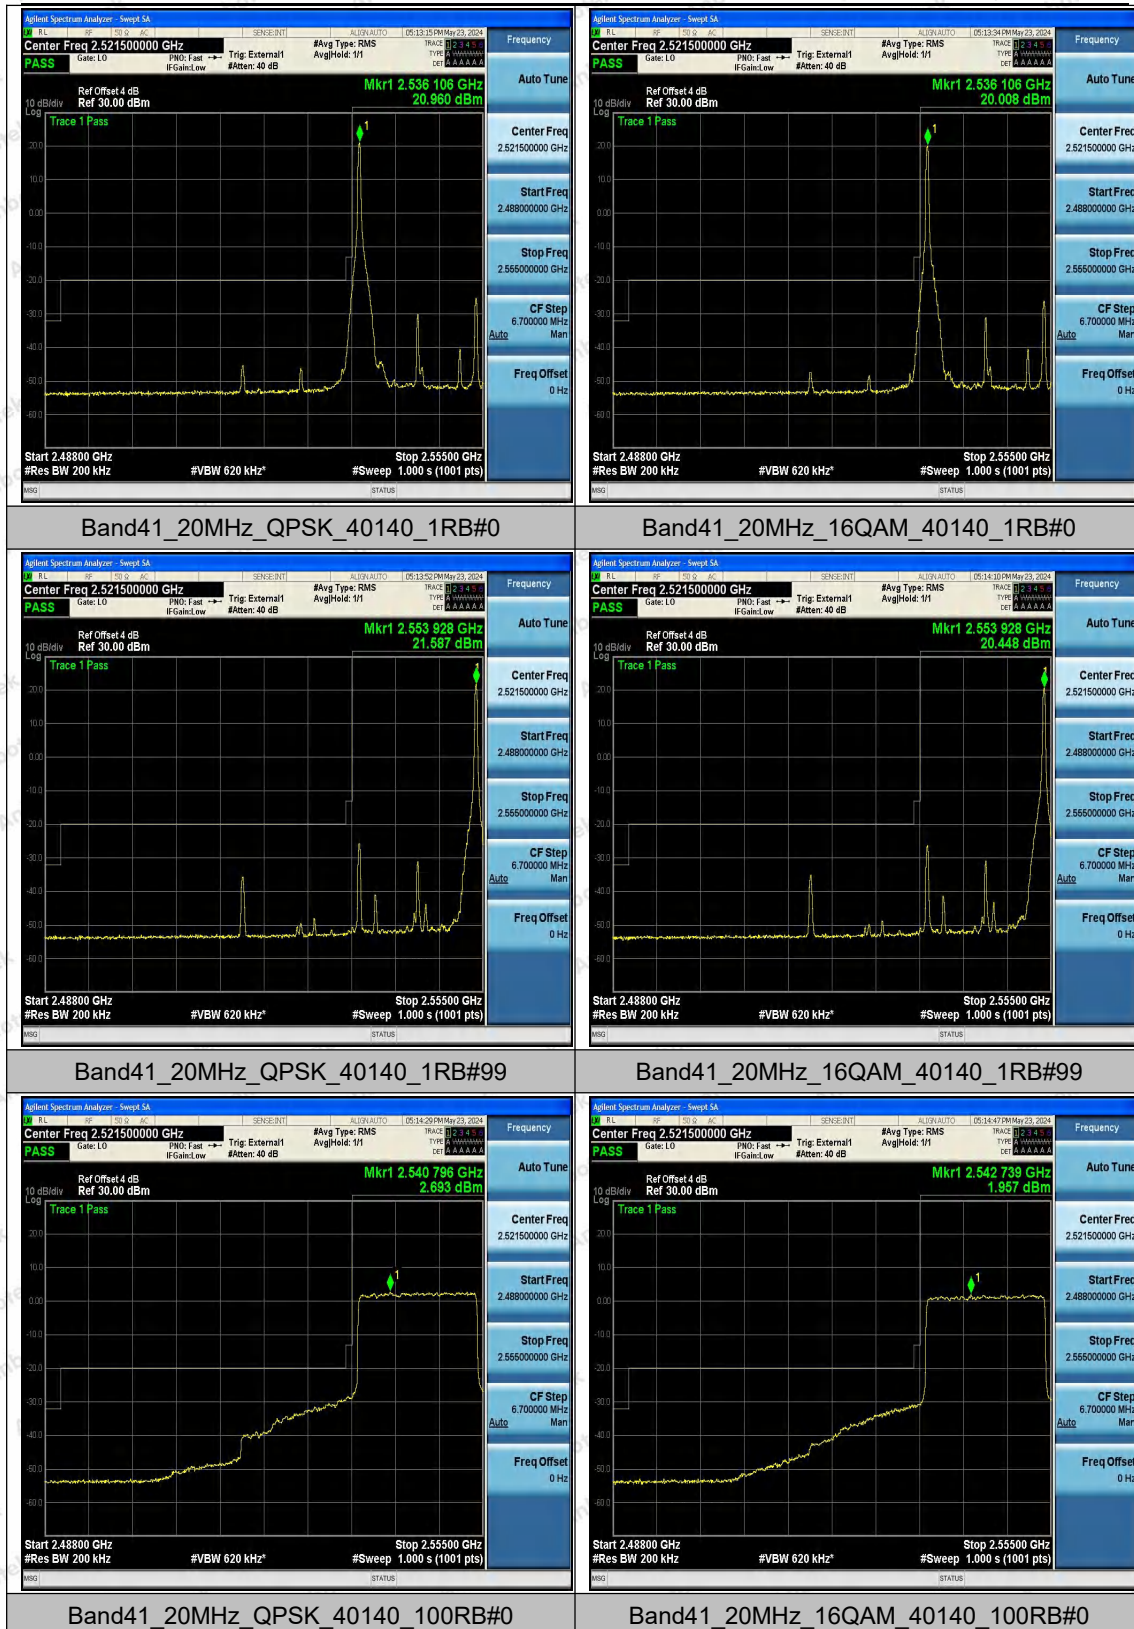


Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



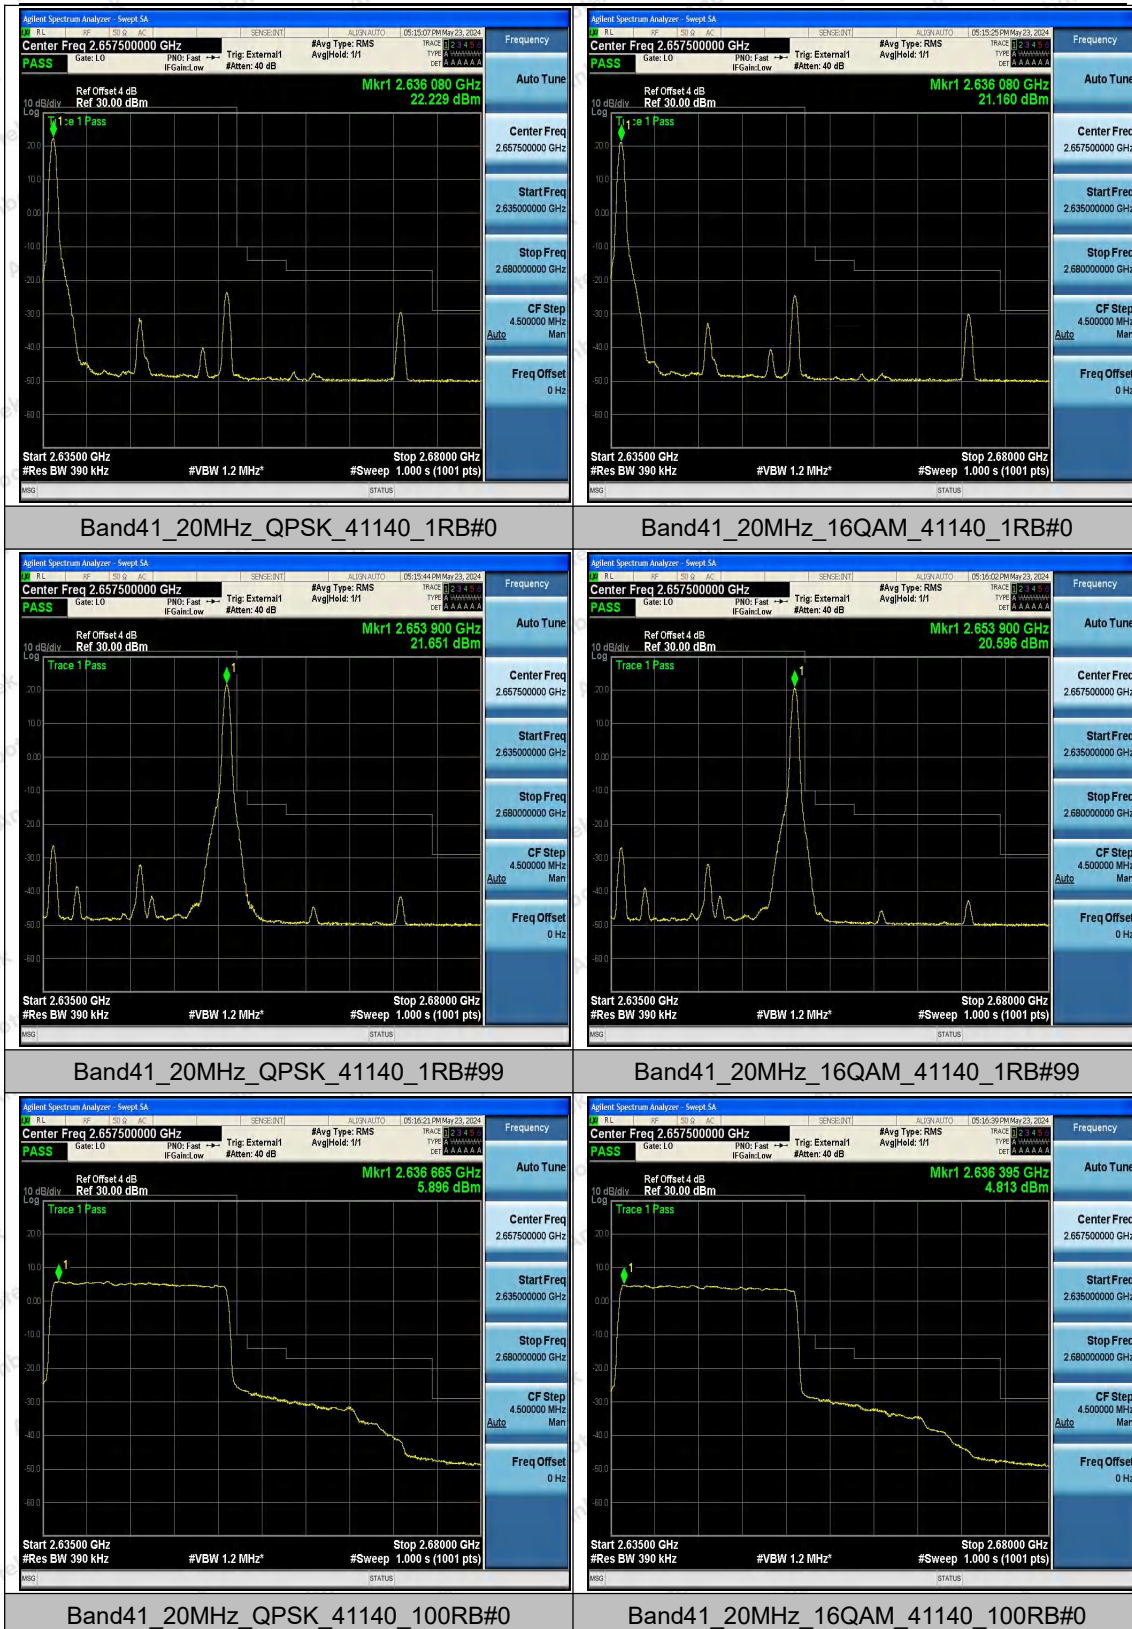

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



Appendix E: Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
41(2535-2655)	5MHz	QPSK	40065	1RB#0	0.009~0.15	-67.68	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#0	0.15~30	-72.07	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#0	30~1000	-66.82	PASS
41(2535-2655)	5MHz	QPSK	40065	1RB#0	20000~27000	-42.15	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	0.009~0.15	-69.85	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	0.15~30	-67.44	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	30~1000	-66.70	PASS
41(2535-2655)	5MHz	16QAM	40065	1RB#0	20000~27000	-41.92	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#0	0.009~0.15	-69.76	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#0	0.15~30	-60.77	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#0	30~1000	-66.64	PASS
41(2535-2655)	5MHz	QPSK	40590	1RB#0	20000~27000	-42.08	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#0	0.009~0.15	-69.07	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#0	0.15~30	-60.56	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#0	30~1000	-66.69	PASS
41(2535-2655)	5MHz	16QAM	40590	1RB#0	20000~27000	-42.08	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	0.009~0.15	-68.76	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	0.15~30	-66.06	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	30~1000	-65.76	PASS
41(2535-2655)	5MHz	QPSK	41215	1RB#0	20000~27000	-42.11	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	0.009~0.15	-70.91	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	0.15~30	-72.77	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	30~1000	-66.81	PASS
41(2535-2655)	5MHz	16QAM	41215	1RB#0	20000~27000	-41.91	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	0.009~0.15	-70.56	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	0.15~30	-70.75	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	30~1000	-66.82	PASS
41(2535-2655)	10MHz	QPSK	40090	1RB#0	20000~27000	-42.20	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	0.009~0.15	-70.51	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	0.15~30	-69.77	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	30~1000	-66.96	PASS
41(2535-2655)	10MHz	16QAM	40090	1RB#0	20000~27000	-42.34	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#0	0.009~0.15	-67.86	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#0	0.15~30	-59.23	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#0	30~1000	-66.59	PASS
41(2535-2655)	10MHz	QPSK	40590	1RB#0	20000~27000	-42.17	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#0	0.009~0.15	-69.74	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community, Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
400-003-0500
www.anbotek.com.cn



41(2535-2655)	10MHz	16QAM	40590	1RB#0	0.15~30	-60.15	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#0	30~1000	-66.77	PASS
41(2535-2655)	10MHz	16QAM	40590	1RB#0	20000~27000	-42.15	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	0.009~0.15	-69.02	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	0.15~30	-70.95	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	30~1000	-63.26	PASS
41(2535-2655)	10MHz	QPSK	41190	1RB#0	20000~27000	-42.04	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	0.009~0.15	-69.85	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	0.15~30	-70.02	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	30~1000	-64.38	PASS
41(2535-2655)	10MHz	16QAM	41190	1RB#0	20000~27000	-42.20	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	0.009~0.15	-69.82	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	0.15~30	-70.65	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	30~1000	-66.53	PASS
41(2535-2655)	15MHz	QPSK	40115	1RB#0	20000~27000	-41.92	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	0.009~0.15	-70.44	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	0.15~30	-67.49	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	30~1000	-67.09	PASS
41(2535-2655)	15MHz	16QAM	40115	1RB#0	20000~27000	-41.91	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#0	0.009~0.15	-70.63	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#0	0.15~30	-59.76	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#0	30~1000	-66.79	PASS
41(2535-2655)	15MHz	QPSK	40590	1RB#0	20000~27000	-41.99	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#0	0.009~0.15	-68.31	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#0	0.15~30	-60.56	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#0	30~1000	-66.86	PASS
41(2535-2655)	15MHz	16QAM	40590	1RB#0	20000~27000	-42.21	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	0.009~0.15	-67.93	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	0.15~30	-67.36	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	30~1000	-65.16	PASS
41(2535-2655)	15MHz	QPSK	41165	1RB#0	20000~27000	-42.11	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	0.009~0.15	-69.39	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	0.15~30	-70.70	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	30~1000	-66.04	PASS
41(2535-2655)	15MHz	16QAM	41165	1RB#0	20000~27000	-42.15	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	0.009~0.15	-70.70	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	0.15~30	-70.49	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	30~1000	-66.86	PASS
41(2535-2655)	20MHz	QPSK	40140	1RB#0	20000~27000	-42.12	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#0	0.009~0.15	-70.21	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#0	0.15~30	-72.37	PASS
41(2535-2655)	20MHz	16QAM	40140	1RB#0	30~1000	-66.60	PASS

Shenzhen Anbotek Compliance Laboratory Limited

Address: 1/F., Building D, Sogood Science and Technology Park, Sanwei Community,
 Hangcheng Street, Bao'an District, Shenzhen, Guangdong, China.
 Tel: (86) 0755-26066440 Fax: (86) 0755-26014772 Email: service@anbotek.com



Hotline
 400-003-0500
 www.anbotek.com.cn

