





Restrict Band NVNT ax40 5190MHz Ant2 Peak

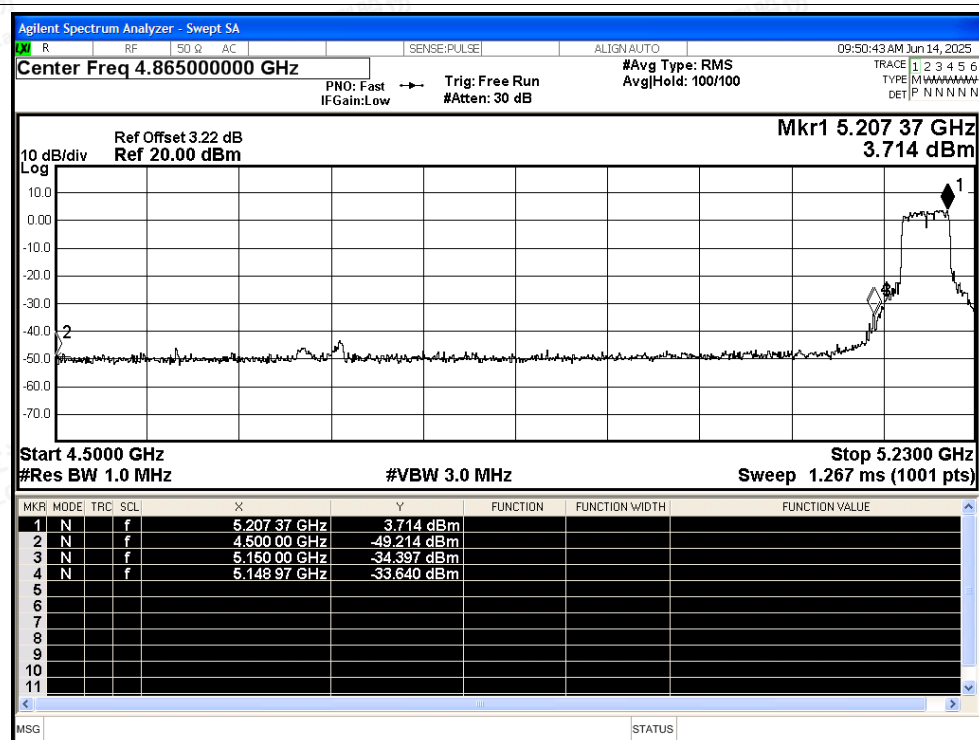

Restrict Band NVNT ax40 5190MHz Ant2 Average

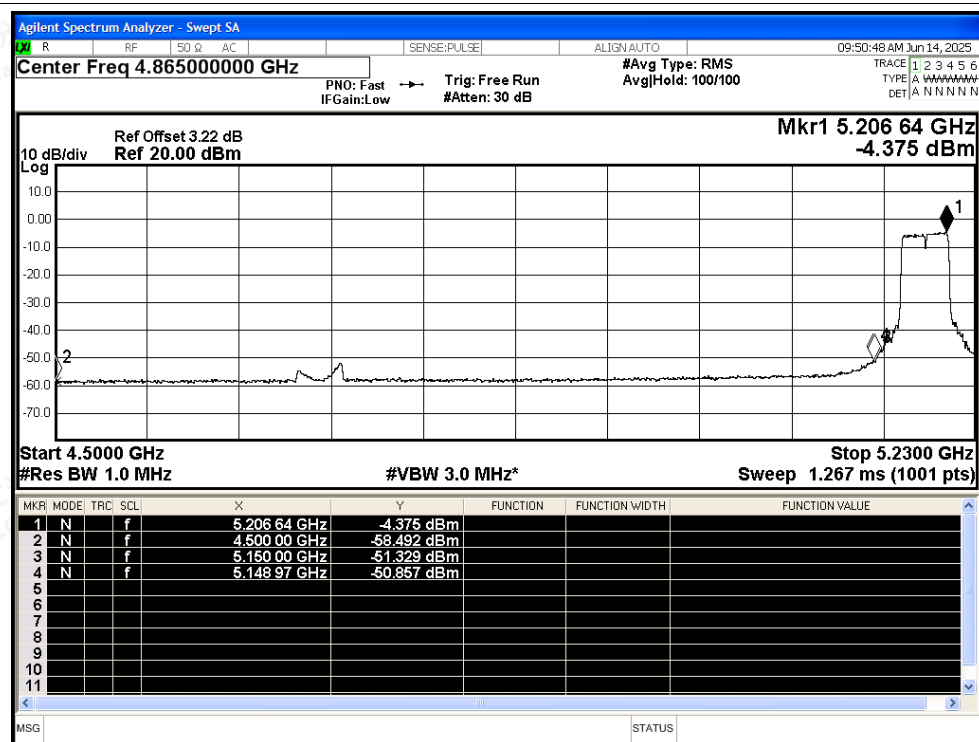

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

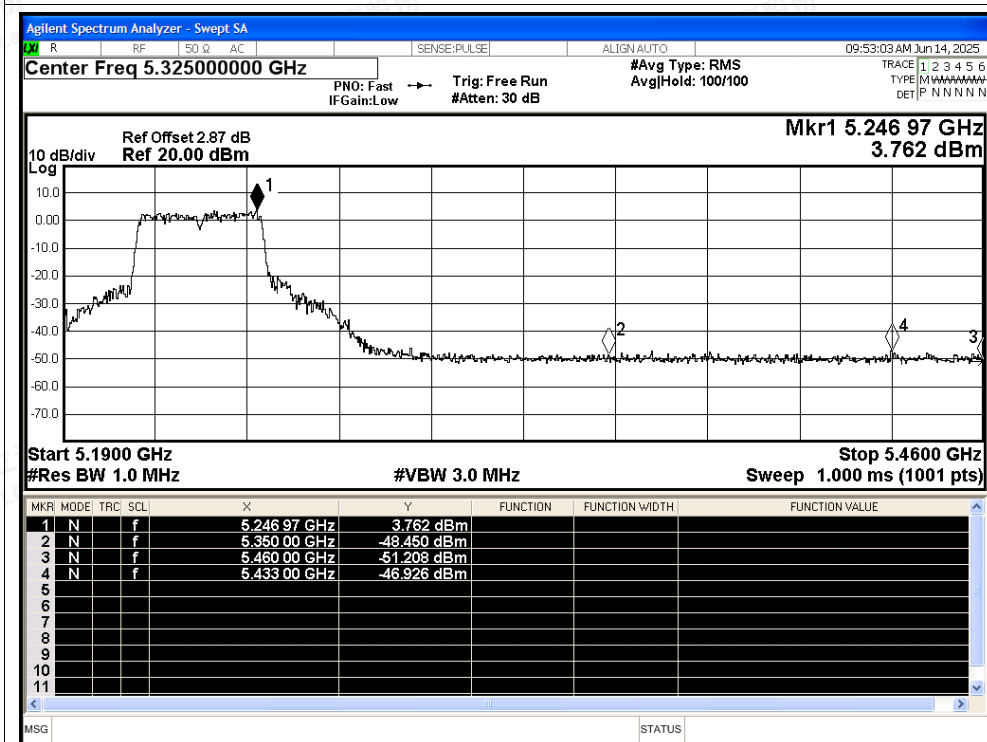

Restrict Band NVNT ax40 5230MHz Ant2 Average

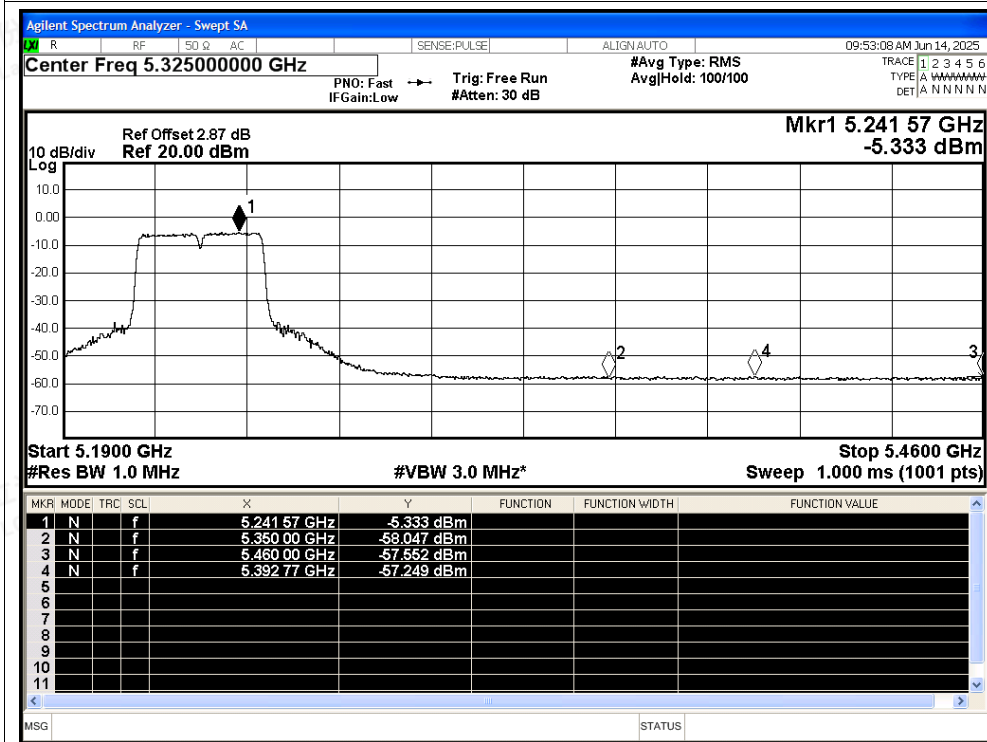

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

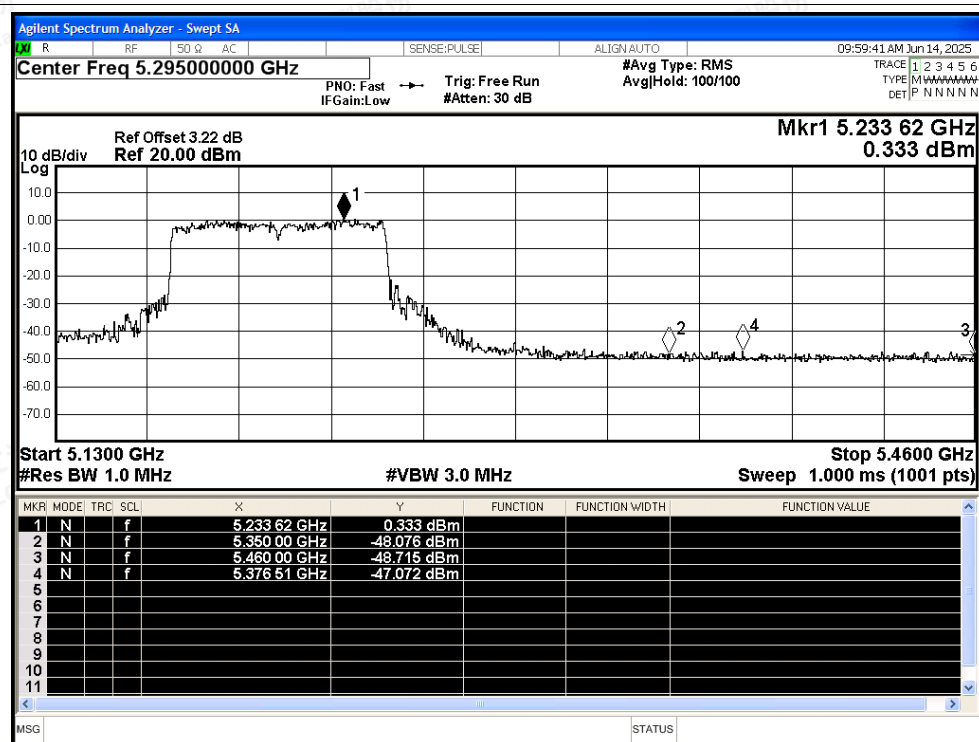

Restrict Band NVNT ax80 5210MHz Ant2 Average

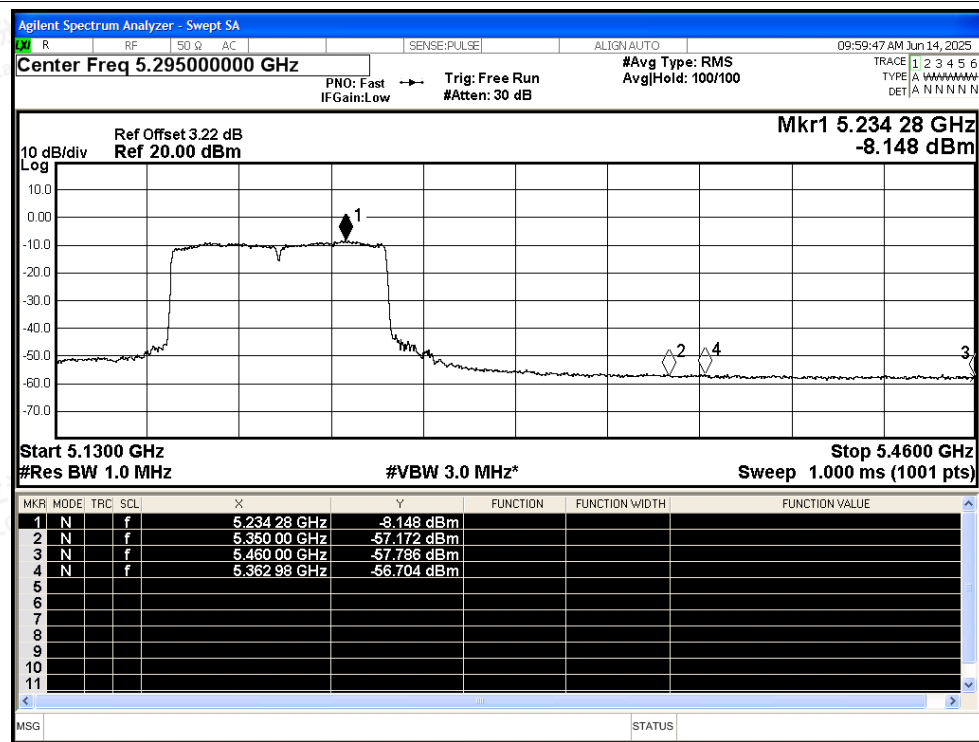

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

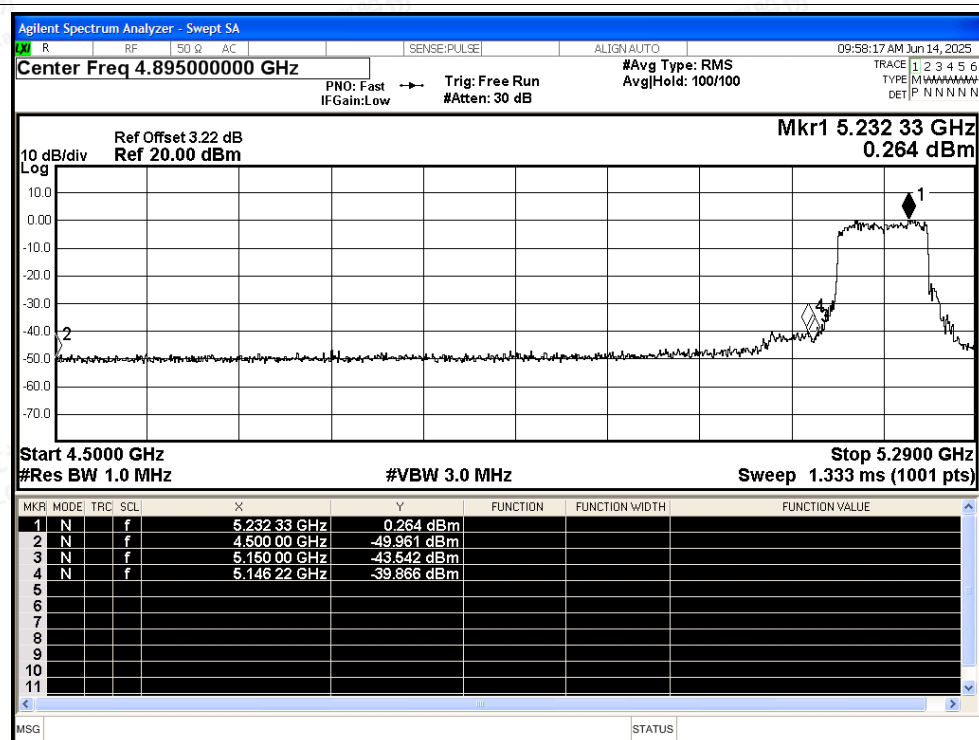

Restrict Band NVNT ax80 5210MHz Ant2 Average

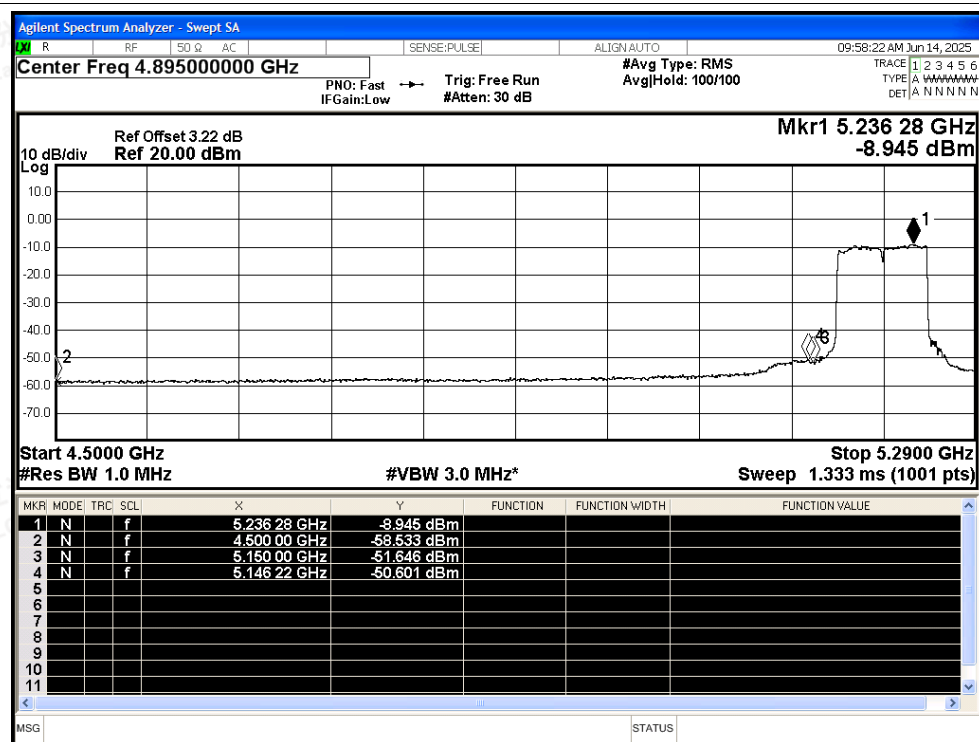

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-50.15	-50.47	6.84	54.77	Peak	68.2	Pass
NVNT	n20	5180	4500	-59.04	-58.95	6.84	46.08	Average	54	Pass
NVNT	n20	5180	5148.9	-47.52	-36.35	6.84	66.04	Peak	68.2	Pass
NVNT	n20	5180	5148.9	-52.74	-54.58	6.84	51.51	Average	54	Pass
NVNT	n20	5180	5150	-46.83	-38.63	6.84	64.05	Peak	68.2	Pass
NVNT	n20	5180	5150	-53.61	-60.04	6.84	49.35	Average	54	Pass
NVNT	n20	5240	5350	-60.08	-50.10	6.84	52.38	Peak	68.2	Pass
NVNT	n20	5240	5350	-58.27	-57.83	6.84	47.03	Average	54	Pass
NVNT	n20	5240	5421.84	-48.15	-47.83	6.84	57.09	Peak	68.2	Pass
NVNT	n20	5240	5367.6	-57.49	-57.59	6.84	47.54	Average	54	Pass
NVNT	n20	5240	5460	-50.32	-50.60	6.84	54.62	Peak	68.2	Pass
NVNT	n20	5240	5460	-58.53	-58.38	6.84	46.62	Average	54	Pass
NVNT	n40	5190	4500	-50.55	-50.47	6.84	54.57	Peak	68.2	Pass
NVNT	n40	5190	4500	-59.49	-59.07	6.84	45.80	Average	54	Pass
NVNT	n40	5190	5145.32	-37.12	-39.86	6.84	66.80	Peak	68.2	Pass
NVNT	n40	5190	5149.7	-59.56	-58.59	6.84	46.03	Average	54	Pass
NVNT	n40	5190	5150	-38.51	-40.78	6.84	65.58	Peak	68.2	Pass
NVNT	n40	5190	5150	-59.55	-58.53	6.84	46.07	Average	54	Pass
NVNT	n40	5230	5350	-50.63	-49.24	6.84	55.20	Peak	68.2	Pass
NVNT	n40	5230	5350	-57.87	-58.17	6.84	47.06	Average	54	Pass
NVNT	n40	5230	5379	-47.38	-47.24	6.84	57.77	Peak	68.2	Pass
NVNT	n40	5230	5352.27	-57.14	-57.58	6.84	47.72	Average	54	Pass
NVNT	n40	5230	5460	-50.94	-49.39	6.84	54.98	Peak	68.2	Pass
NVNT	n40	5230	5460	-58.39	-58.88	6.84	46.45	Average	54	Pass
NVNT	ac20	5180	4500	-50.59	-50.78	6.84	54.39	Peak	68.2	Pass
NVNT	ac20	5180	4500	-58.90	-58.81	6.84	46.22	Average	54	Pass
NVNT	ac20	5180	5148.9	-45.86	-45.24	6.84	59.54	Peak	68.2	Pass
NVNT	ac20	5180	5149.6	-59.21	-56.35	6.84	47.53	Average	54	Pass
NVNT	ac20	5180	5150	-44.00	-47.42	6.84	59.70	Peak	68.2	Pass
NVNT	ac20	5180	5150	-58.63	-49.45	6.84	53.11	Average	54	Pass
NVNT	ac20	5240	5350	-48.37	-50.60	6.84	55.73	Peak	68.2	Pass
NVNT	ac20	5240	5350	-57.15	-57.52	6.84	47.75	Average	54	Pass
NVNT	ac20	5240	5351.04	-47.91	-47.75	6.84	57.25	Peak	68.2	Pass
NVNT	ac20	5240	5350.08	-57.22	-57.27	6.84	47.83	Average	54	Pass
NVNT	ac20	5240	5460	-50.38	-49.96	6.84	54.91	Peak	68.2	Pass
NVNT	ac20	5240	5460	-58.70	-58.64	6.84	46.41	Average	54	Pass
NVNT	ac40	5190	4500	-50.15	-51.92	6.84	54.13	Peak	68.2	Pass
NVNT	ac40	5190	4500	-58.88	-59.01	6.84	46.13	Average	54	Pass
NVNT	ac40	5190	5148.97	-51.75	-37.26	6.84	64.96	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	5149.7	-58.16	-57.73	6.84	47.14	Average	54	Pass
NVNT	ac40	5190	5150	-44.02	-47.28	6.84	59.73	Peak	68.2	Pass
NVNT	ac40	5190	5150	-58.03	-57.88	6.84	47.12	Average	54	Pass
NVNT	ac40	5230	5350	-49.45	-49.92	6.84	55.40	Peak	68.2	Pass
NVNT	ac40	5230	5350	-58.20	-58.34	6.84	46.81	Average	54	Pass
NVNT	ac40	5230	5358.75	-46.91	-47.34	6.84	57.96	Peak	68.2	Pass
NVNT	ac40	5230	5350.38	-57.04	-57.61	6.84	47.76	Average	54	Pass
NVNT	ac40	5230	5460	-51.18	-48.51	6.84	55.43	Peak	68.2	Pass
NVNT	ac40	5230	5460	-58.13	-58.48	6.84	46.78	Average	54	Pass
NVNT	ac80	5210	5350	-50.52	-49.43	6.84	55.14	Peak	68.2	Pass
NVNT	ac80	5210	5350	-57.48	-57.04	6.84	47.82	Average	54	Pass
NVNT	ac80	5210	5358.69	-47.25	-46.52	6.84	58.21	Peak	68.2	Pass
NVNT	ac80	5210	5352.09	-57.11	-56.85	6.84	48.10	Average	54	Pass
NVNT	ac80	5210	5460	-50.74	-49.46	6.84	55.02	Peak	68.2	Pass
NVNT	ac80	5210	5460	-57.83	-58.21	6.84	47.06	Average	54	Pass
NVNT	ac80	5210	4500	-50.74	-50.87	6.84	54.27	Peak	68.2	Pass
NVNT	ac80	5210	4500	-58.77	-58.84	6.84	46.27	Average	54	Pass
NVNT	ac80	5210	5149.38	-45.58	-48.73	6.84	58.20	Peak	68.2	Pass
NVNT	ac80	5210	5143.06	-59.79	-49.38	6.84	53.07	Average	54	Pass
NVNT	ac80	5210	5150	-43.24	-40.06	6.84	63.71	Peak	68.2	Pass
NVNT	ac80	5210	5150	-51.84	-51.45	6.84	53.44	Average	54	Pass
NVNT	ax20	5180	4500	-49.97	-50.83	6.84	54.70	Peak	68.2	Pass
NVNT	ax20	5180	4500	-59.49	-58.78	6.84	45.96	Average	54	Pass
NVNT	ax20	5180	5148.2	-38.76	-38.43	6.84	66.49	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	-59.30	-60.38	6.84	45.27	Average	54	Pass
NVNT	ax20	5180	5150	-57.35	-38.49	6.84	63.63	Peak	68.2	Pass
NVNT	ax20	5180	5150	-60.30	-55.32	6.84	47.95	Average	54	Pass
NVNT	ax20	5240	5350	-50.12	-49.28	6.84	55.40	Peak	68.2	Pass
NVNT	ax20	5240	5350	-58.11	-57.96	6.84	47.04	Average	54	Pass
NVNT	ax20	5240	5404.32	-47.18	-47.59	6.84	57.70	Peak	68.2	Pass
NVNT	ax20	5240	5352.48	-57.20	-57.21	6.84	47.87	Average	54	Pass
NVNT	ax20	5240	5460	-50.44	-50.20	6.84	54.76	Peak	68.2	Pass
NVNT	ax20	5240	5460	-58.58	-58.32	6.84	46.63	Average	54	Pass
NVNT	ax40	5190	4500	-51.56	-49.49	6.84	54.68	Peak	68.2	Pass
NVNT	ax40	5190	4500	-59.32	-58.85	6.84	46.00	Average	54	Pass
NVNT	ax40	5190	5149.7	-46.92	-43.96	6.84	59.89	Peak	68.2	Pass
NVNT	ax40	5190	5148.97	-59.43	-51.16	6.84	51.51	Average	54	Pass
NVNT	ax40	5190	5150	-47.08	-44.81	6.84	59.28	Peak	68.2	Pass
NVNT	ax40	5190	5150	-59.78	-51.50	6.84	51.17	Average	54	Pass
NVNT	ax40	5230	5350	-50.61	-48.85	6.84	55.44	Peak	68.2	Pass
NVNT	ax40	5230	5350	-57.98	-58.39	6.84	46.90	Average	54	Pass
NVNT	ax40	5230	5377.38	-47.32	-47.18	6.84	57.83	Peak	68.2	Pass
NVNT	ax40	5230	5350.38	-57.45	-57.56	6.84	47.57	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5460	-50.70	-51.39	6.84	54.05	Peak	68.2	Pass
NVNT	ax40	5230	5460	-58.56	-57.84	6.84	46.89	Average	54	Pass
NVNT	ax80	5210	5350	-49.51	-48.37	6.84	56.18	Peak	68.2	Pass
NVNT	ax80	5210	5350	-58.43	-57.45	6.84	47.17	Average	54	Pass
NVNT	ax80	5210	5395.65	-47.66	-47.46	6.84	57.52	Peak	68.2	Pass
NVNT	ax80	5210	5351.43	-57.20	-57.04	6.84	47.96	Average	54	Pass
NVNT	ax80	5210	5460	-49.68	-48.98	6.84	55.76	Peak	68.2	Pass
NVNT	ax80	5210	5460	-58.13	-58.12	6.84	46.95	Average	54	Pass
NVNT	ax80	5210	4500	-52.12	-50.14	6.84	54.06	Peak	68.2	Pass
NVNT	ax80	5210	4500	-59.03	-58.78	6.84	46.17	Average	54	Pass
NVNT	ax80	5210	5143.06	-43.64	-40.26	6.84	63.45	Peak	68.2	Pass
NVNT	ax80	5210	5148.59	-53.29	-56.00	6.84	50.64	Average	54	Pass
NVNT	ax80	5210	5150	-45.26	-43.84	6.84	60.59	Peak	68.2	Pass
NVNT	ax80	5210	5150	-54.03	-51.81	6.84	52.30	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5180	0	0	25	Pass
NVNT	a	5200	Ant1	5200	0	0	25	Pass
NVNT	a	5240	Ant1	5240	0	0	25	Pass
NVNT	n20	5180	Ant1	5180	0	0	25	Pass
NVNT	n20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230.04	40000	7.65	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass
NVNT	ax20	5180	Ant1	5179.96	-40000	-7.72	25	Pass
NVNT	ax20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant1	5190	0	0	25	Pass
NVNT	ax40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant1	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

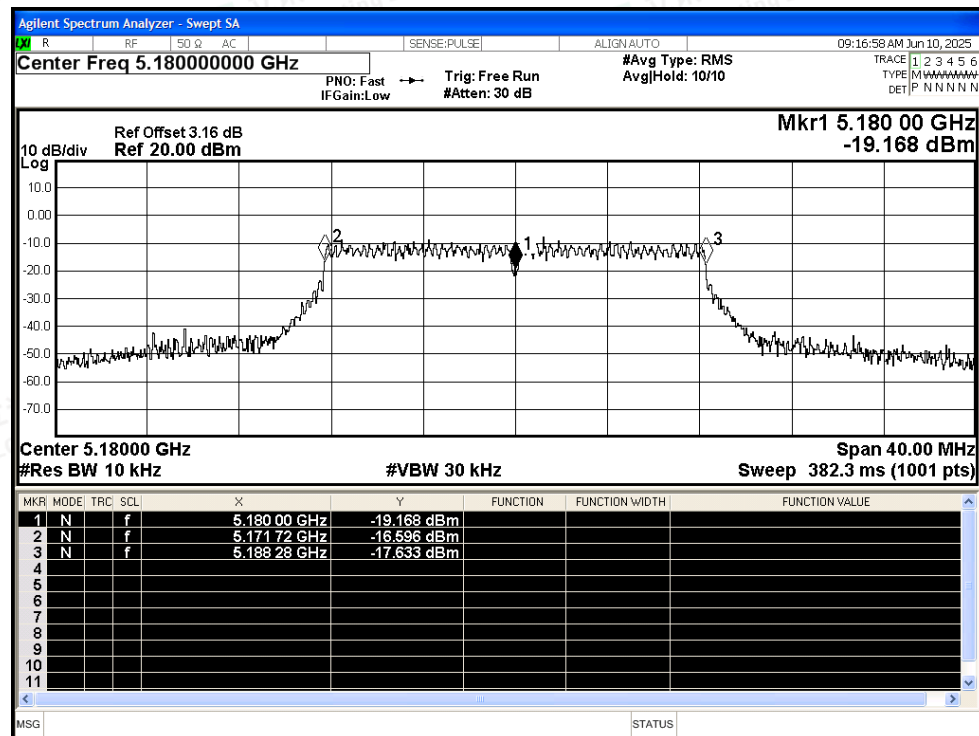

Freq. Stability NVNT a 5200MHz Ant1

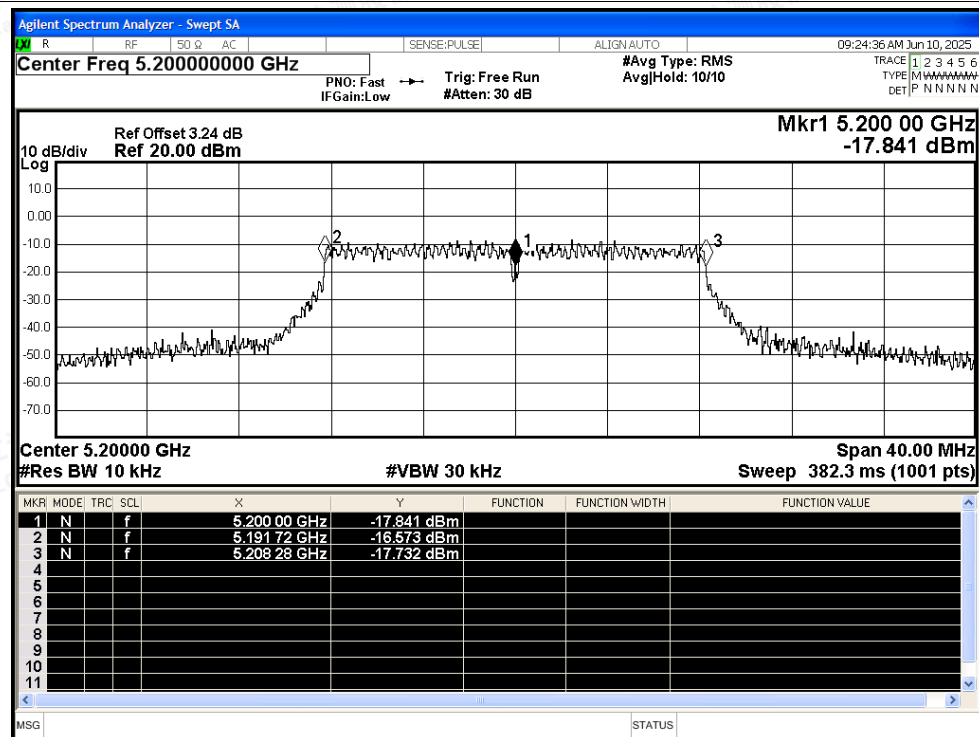

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant1

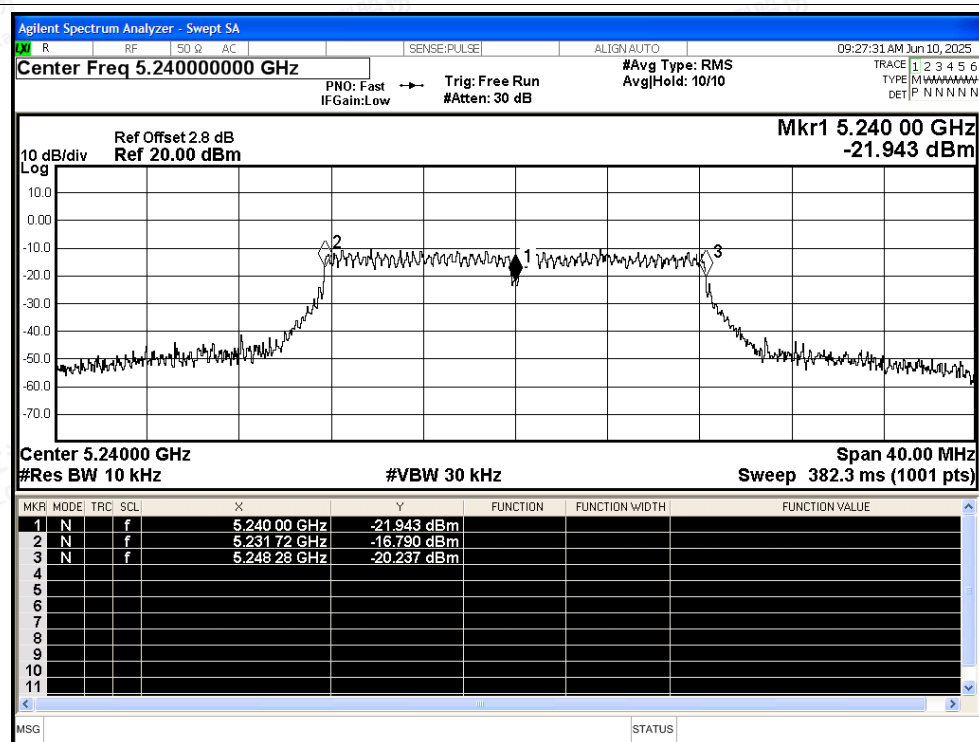

Freq. Stability NVNT n20 5180MHz Ant1

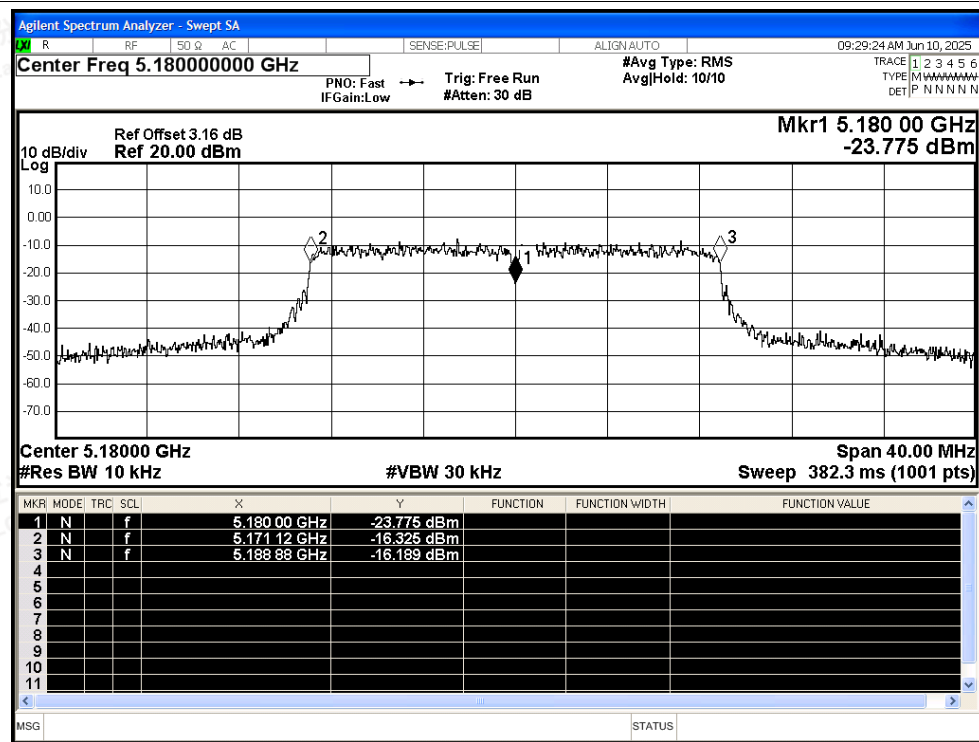

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant1

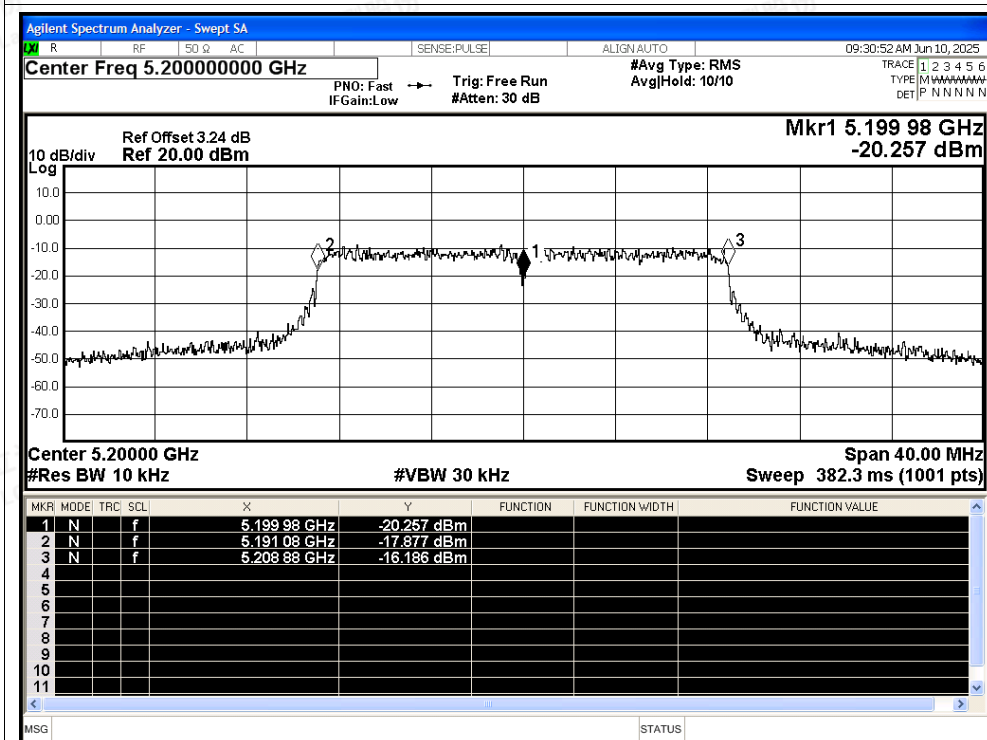

Freq. Stability NVNT n20 5240MHz Ant1

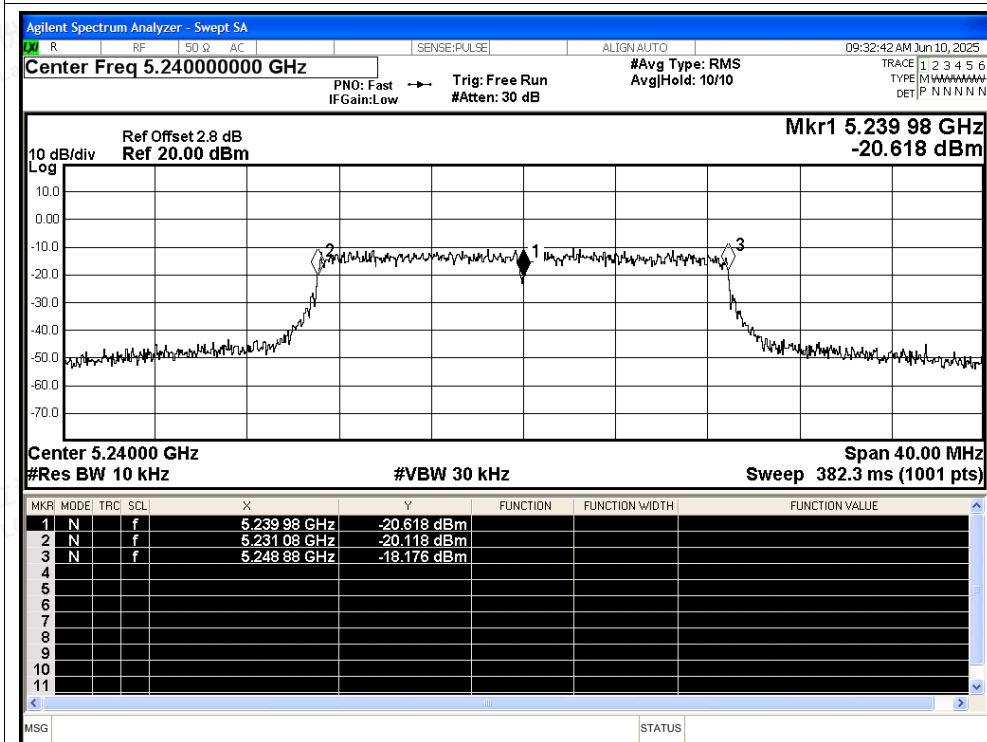

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant1

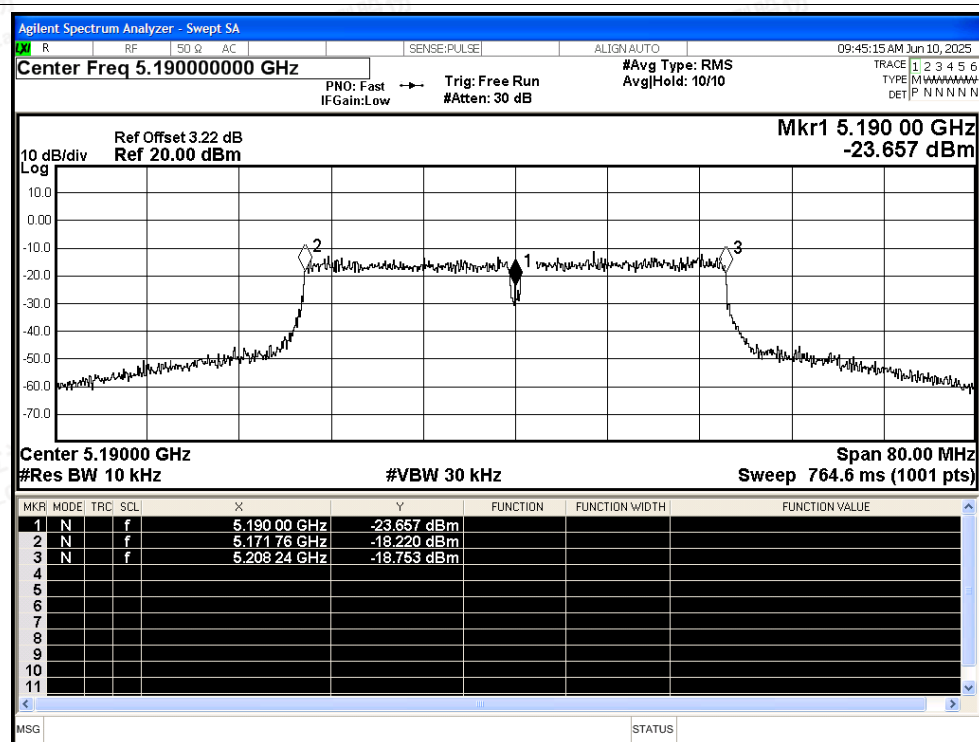

Freq. Stability NVNT n40 5230MHz Ant1

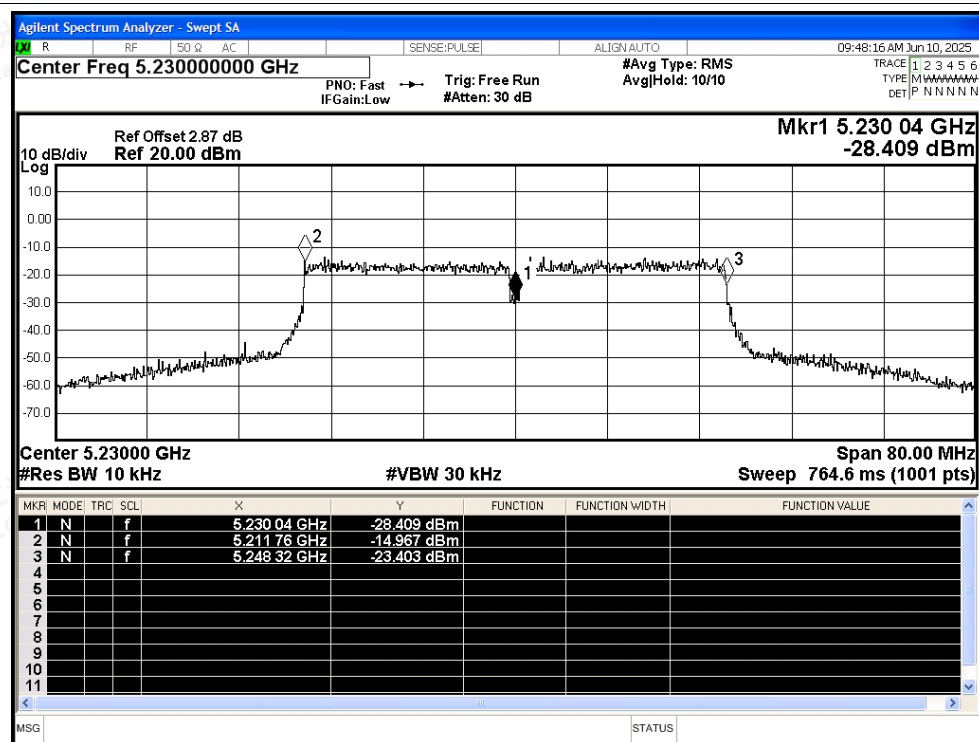

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

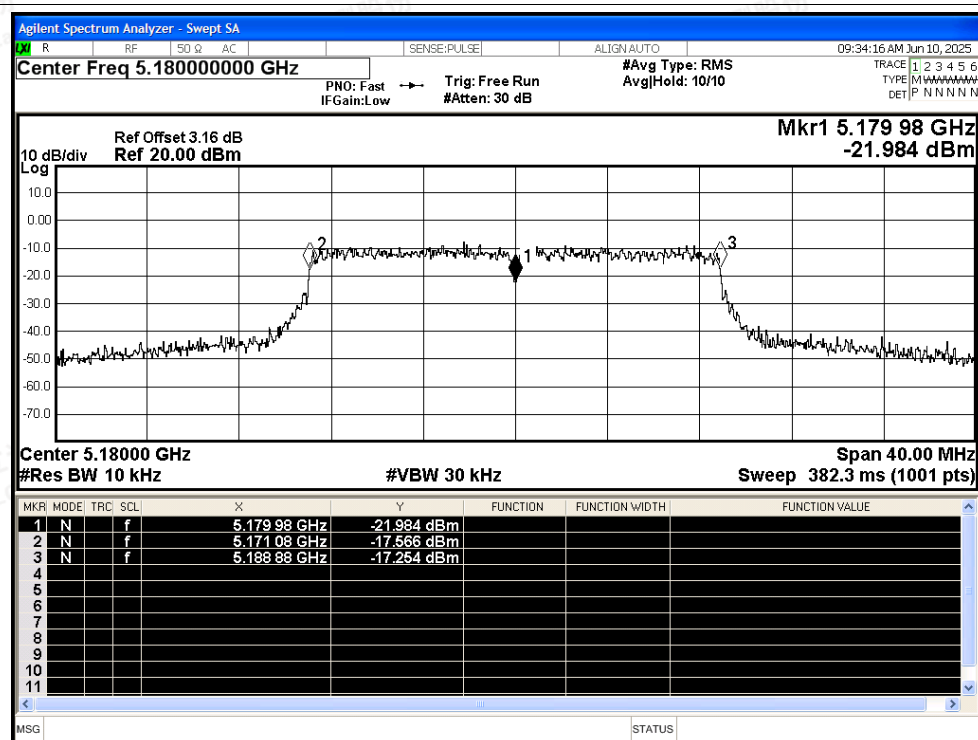

Freq. Stability NVNT ac20 5200MHz Ant1

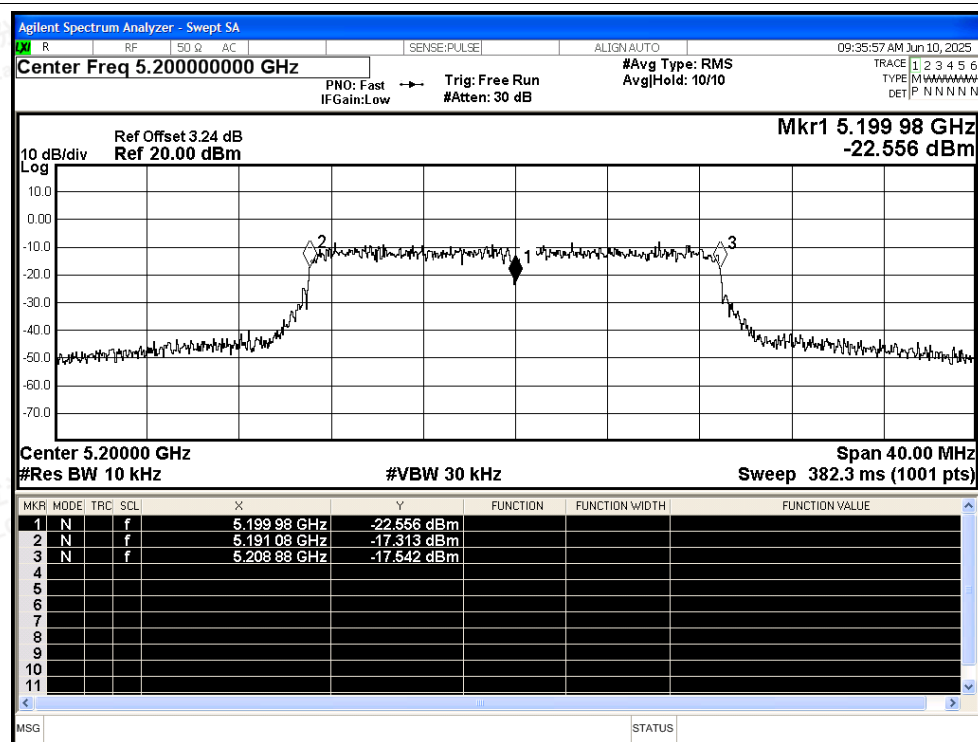

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

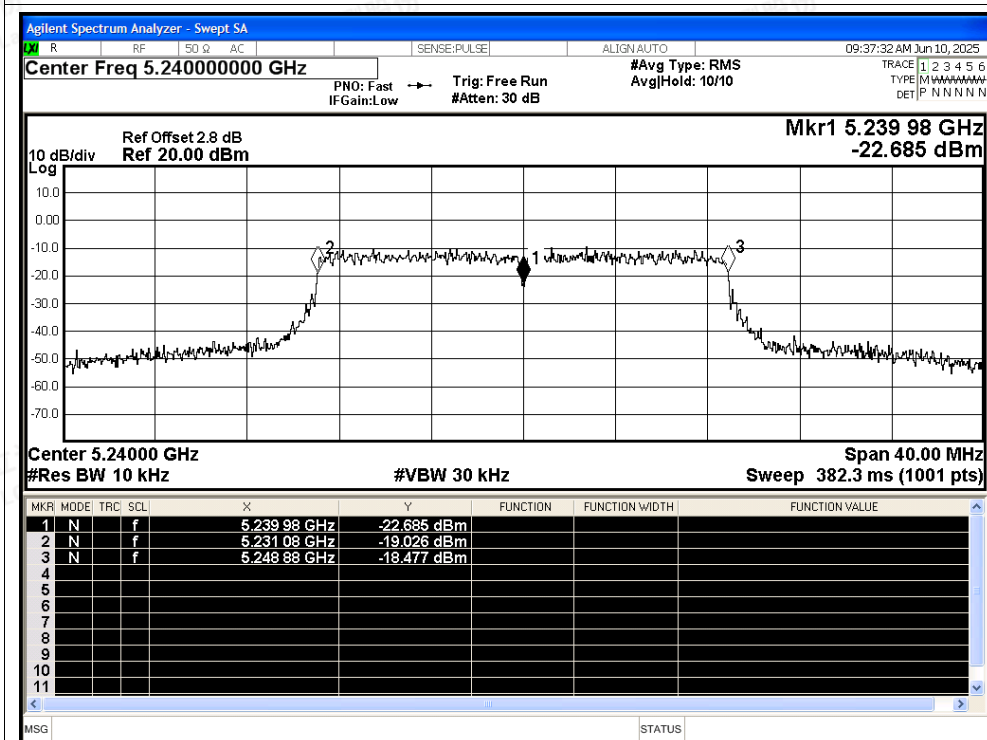

Freq. Stability NVNT ac40 5190MHz Ant1

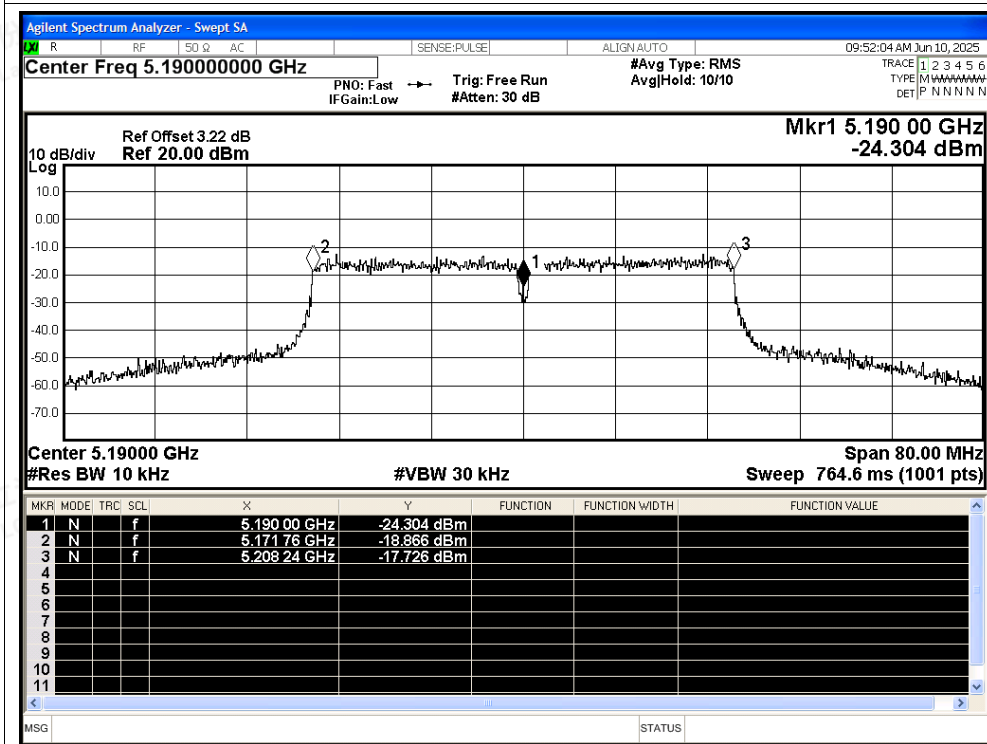

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

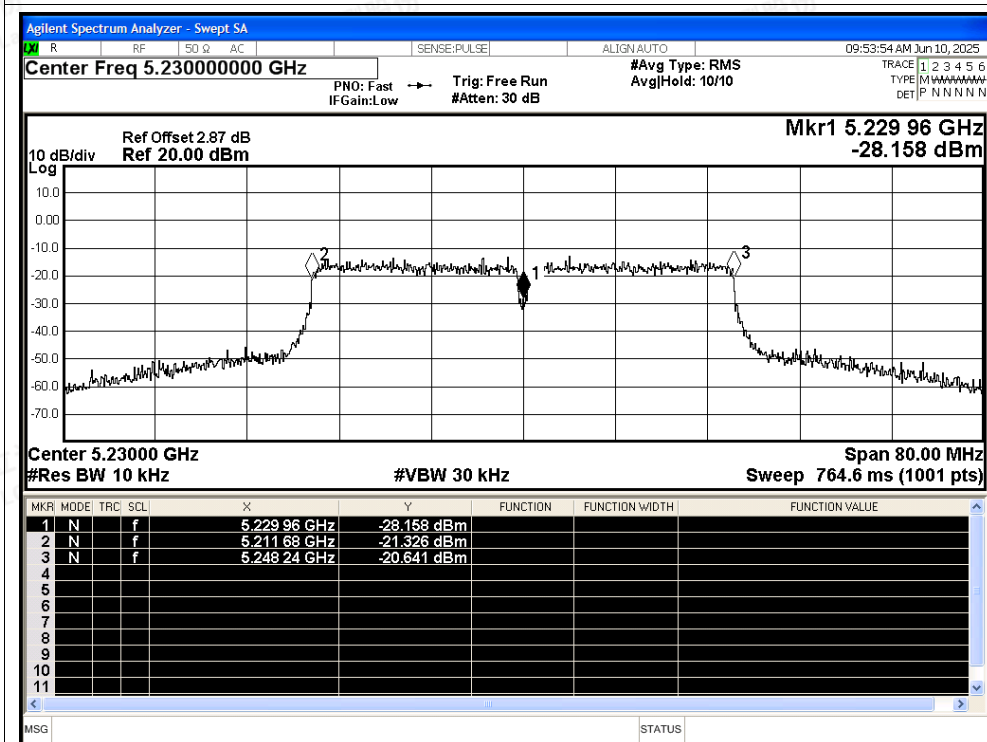

Freq. Stability NVNT ac80 5210MHz Ant1

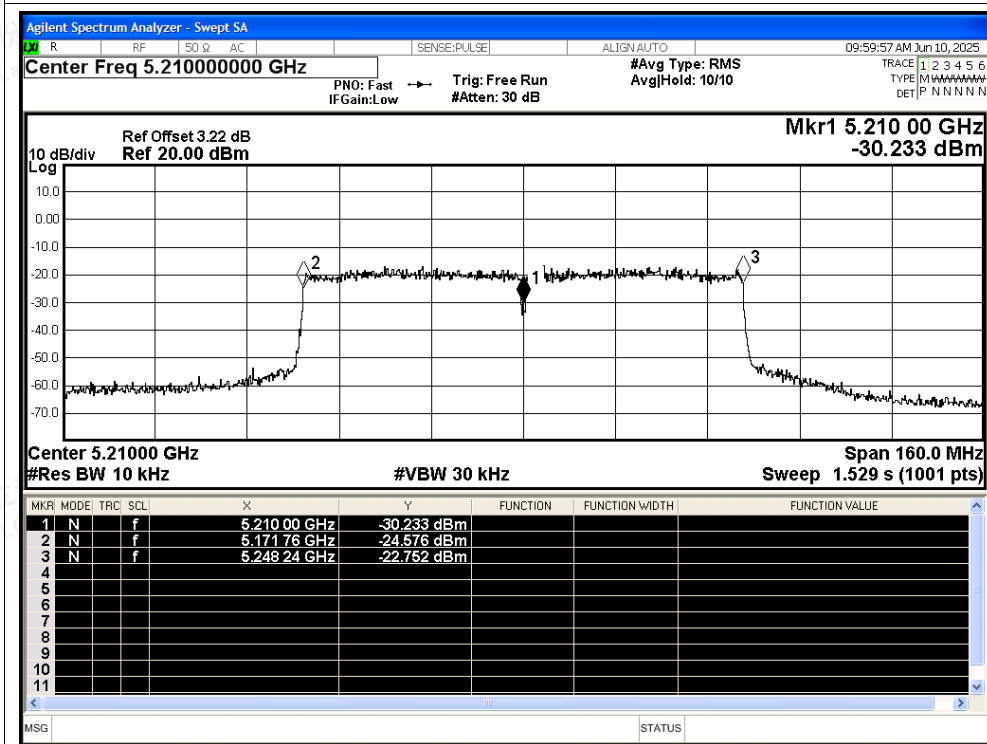

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant1

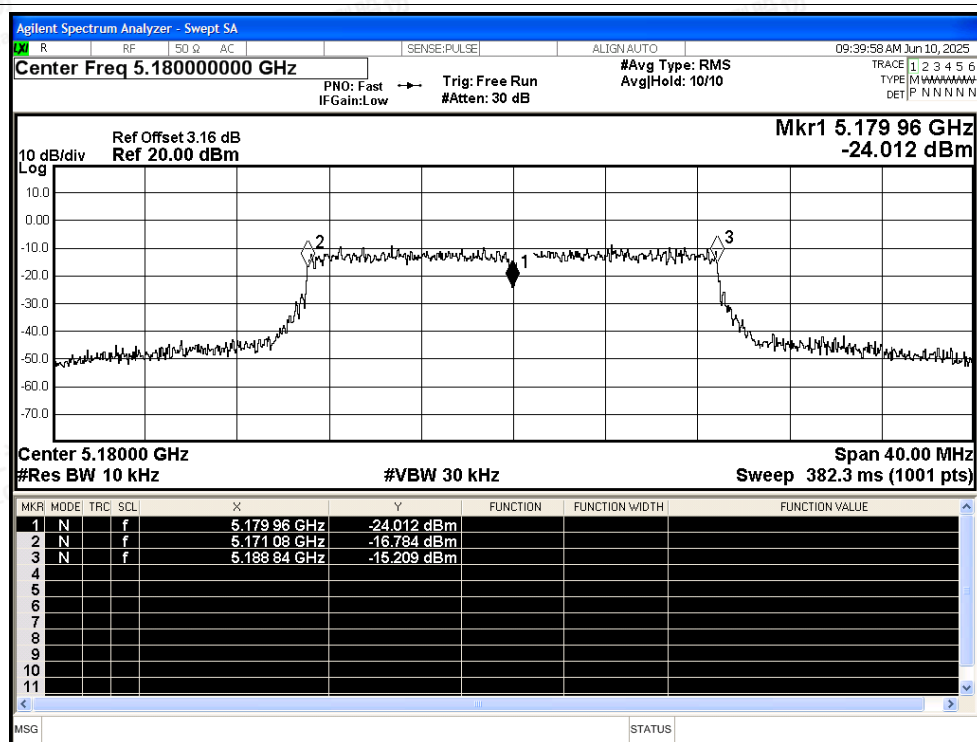

Freq. Stability NVNT ax20 5200MHz Ant1

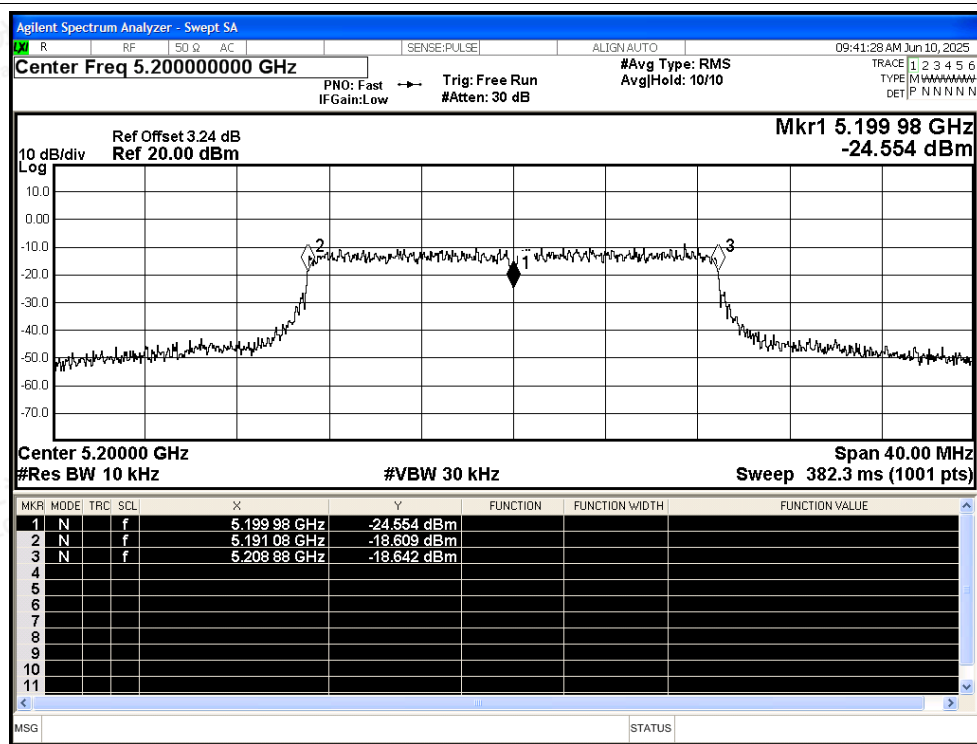

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant1

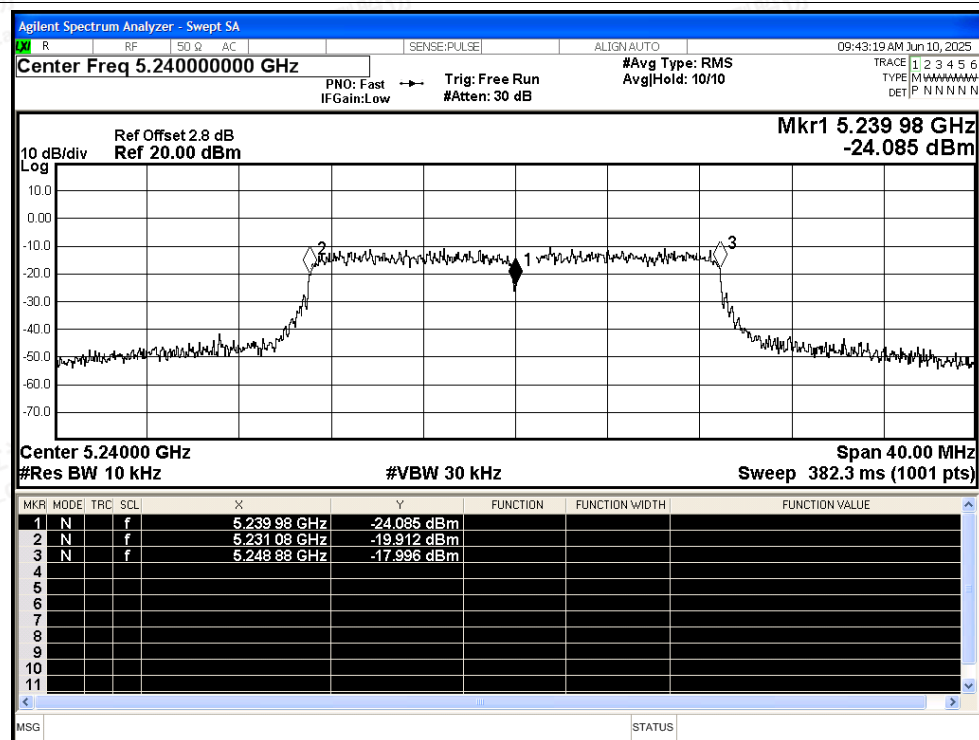

Freq. Stability NVNT ax40 5190MHz Ant1

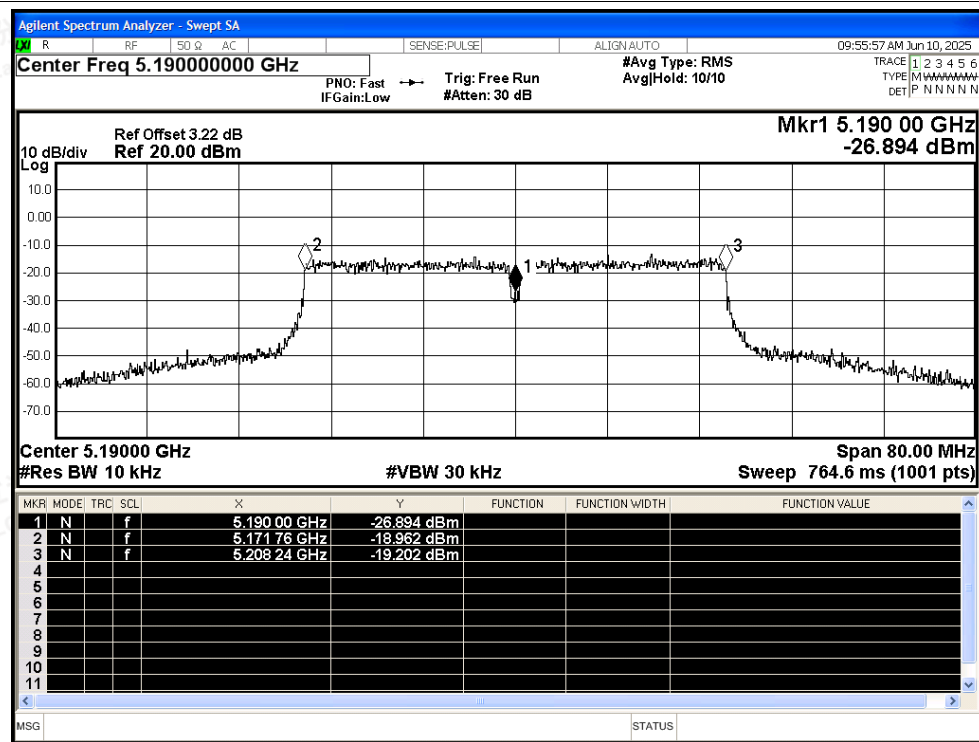

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant1

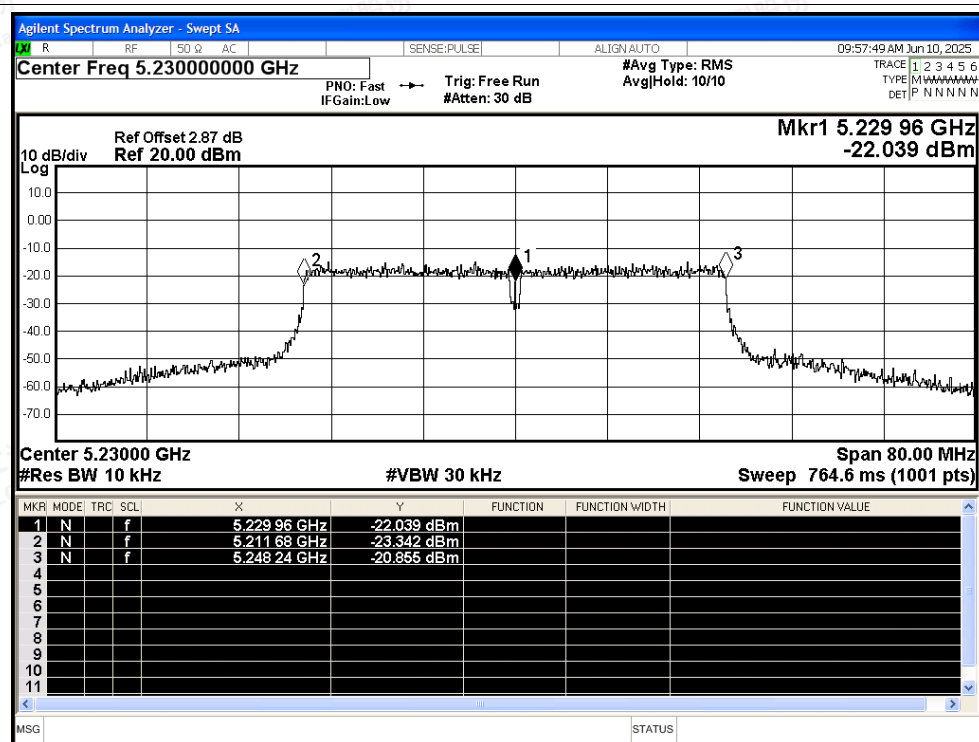

Freq. Stability NVNT ax80 5210MHz Ant1

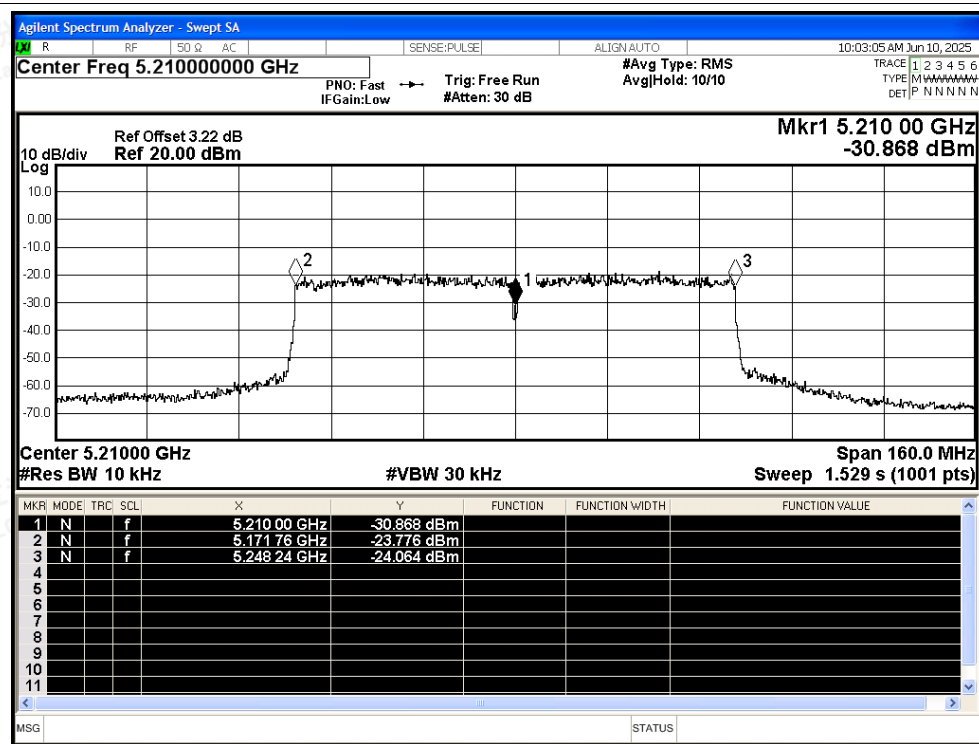

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180	0	0	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant2	5179.96	-40000	-7.72	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5240	0	0	25	Pass
NVNT	n40	5190	Ant2	5190	0	0	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant2	5200	0	0	25	Pass
NVNT	ac20	5240	Ant2	5240	0	0	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass
NVNT	ax20	5180	Ant2	5180	0	0	25	Pass
NVNT	ax20	5200	Ant2	5200	0	0	25	Pass
NVNT	ax20	5240	Ant2	5240	0	0	25	Pass
NVNT	ax40	5190	Ant2	5190	0	0	25	Pass
NVNT	ax40	5230	Ant2	5230.04	40000	7.65	25	Pass
NVNT	ax80	5210	Ant2	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

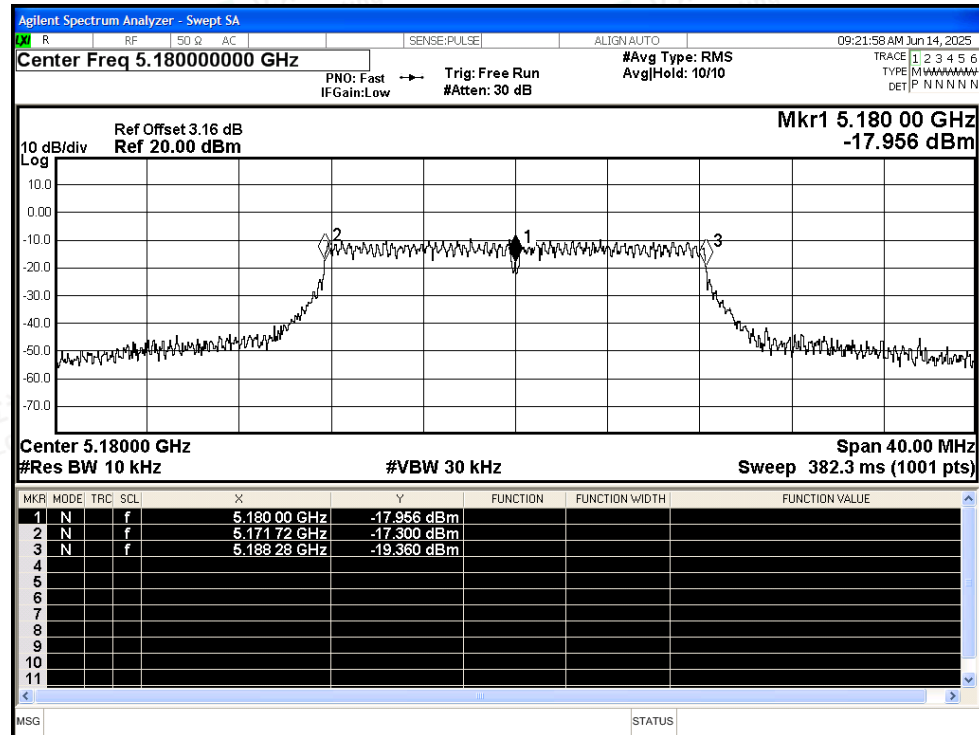

Freq. Stability NVNT a 5200MHz Ant2

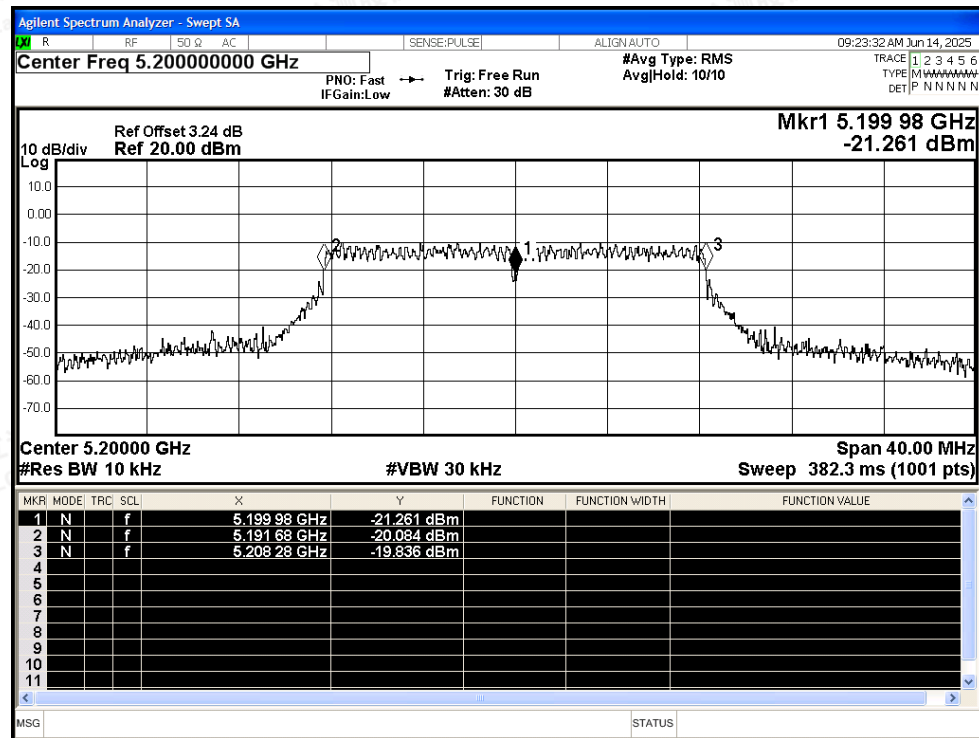

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant2

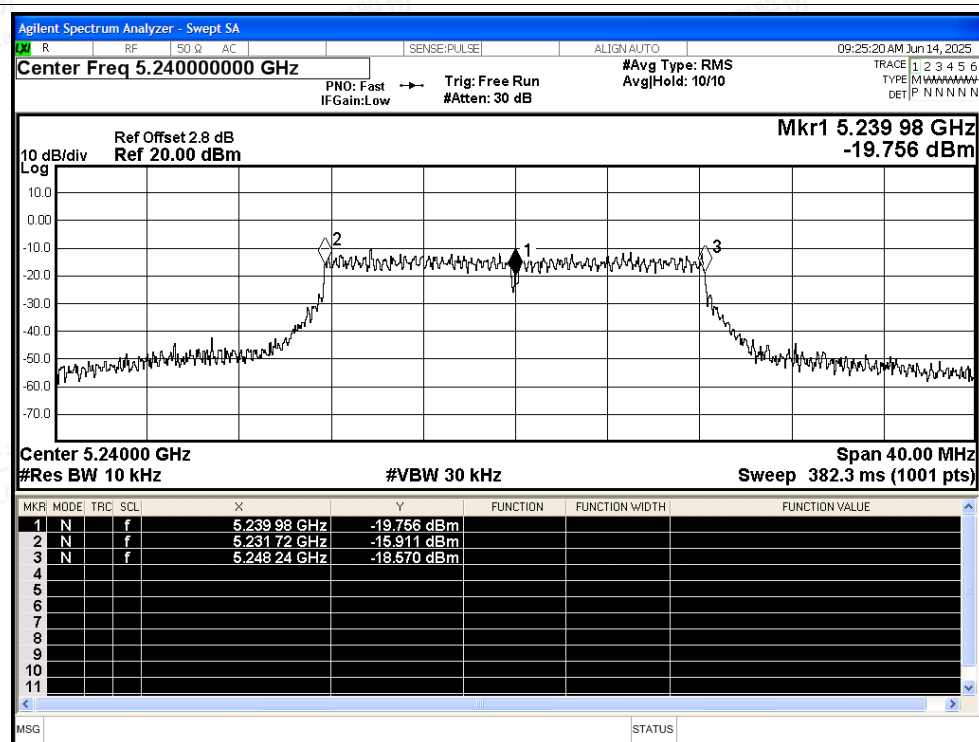

Freq. Stability NVNT n20 5180MHz Ant2

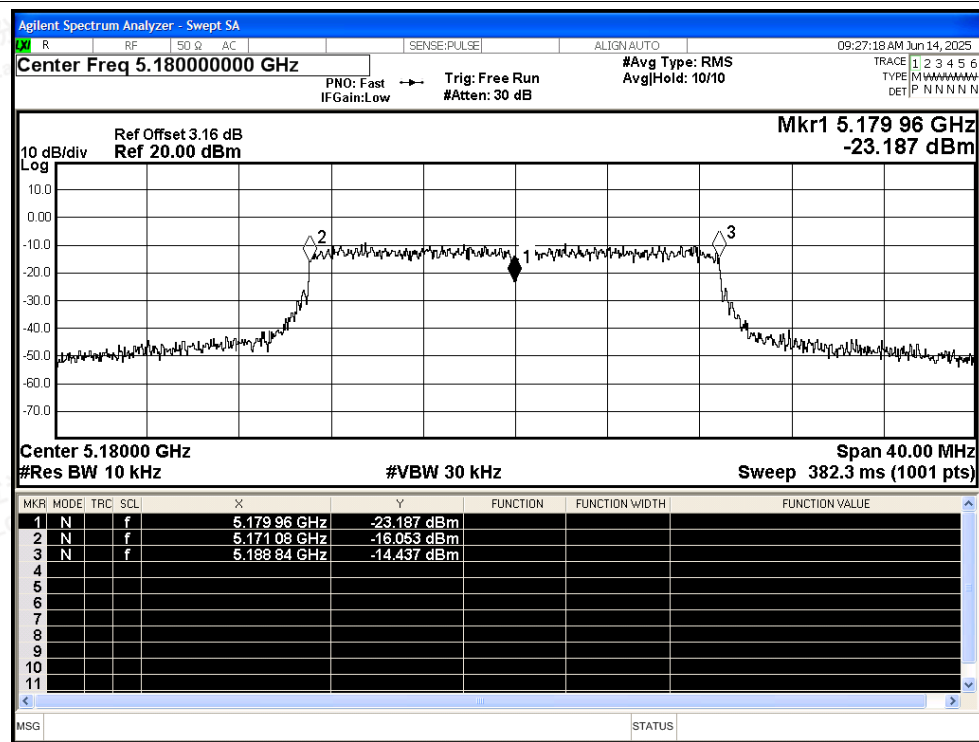

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant2

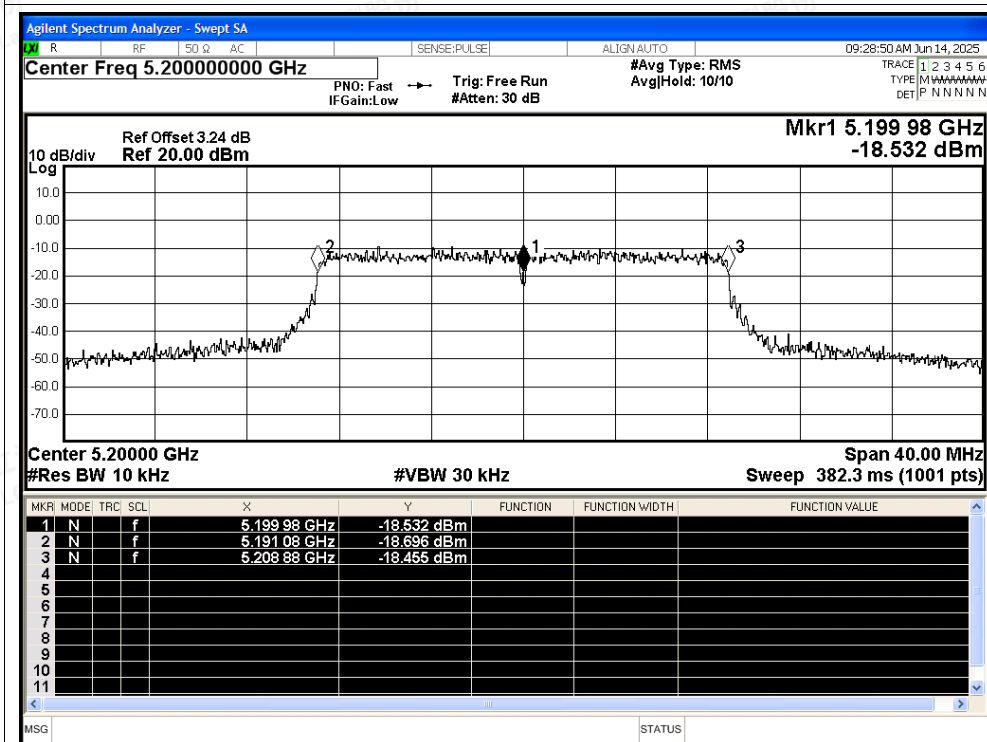

Freq. Stability NVNT n20 5240MHz Ant2

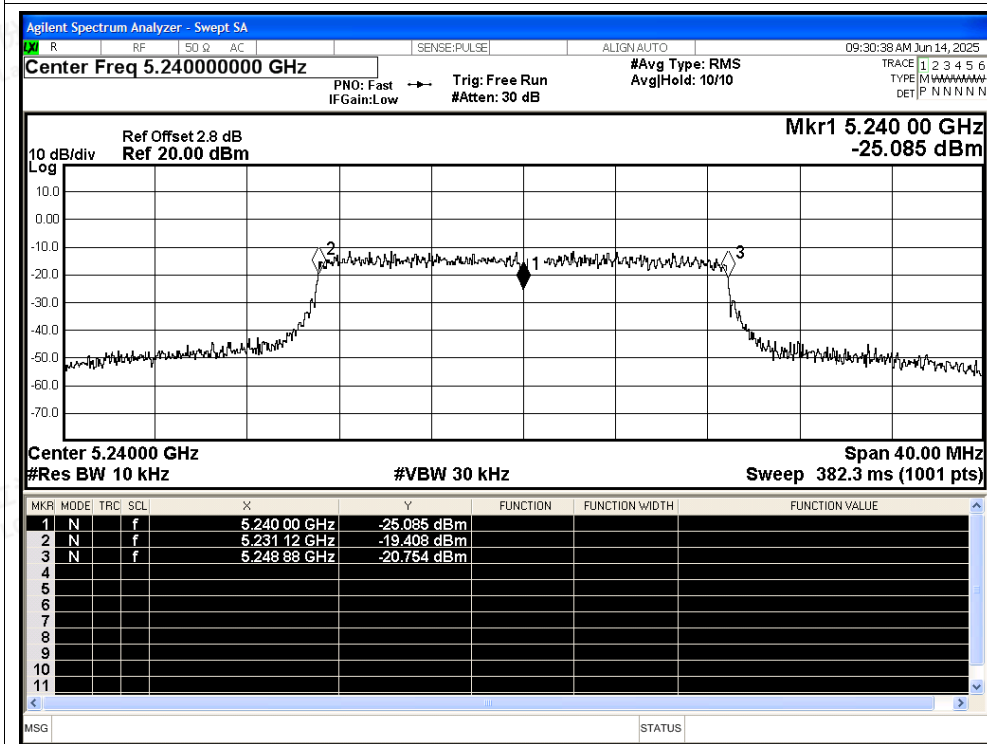

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant2

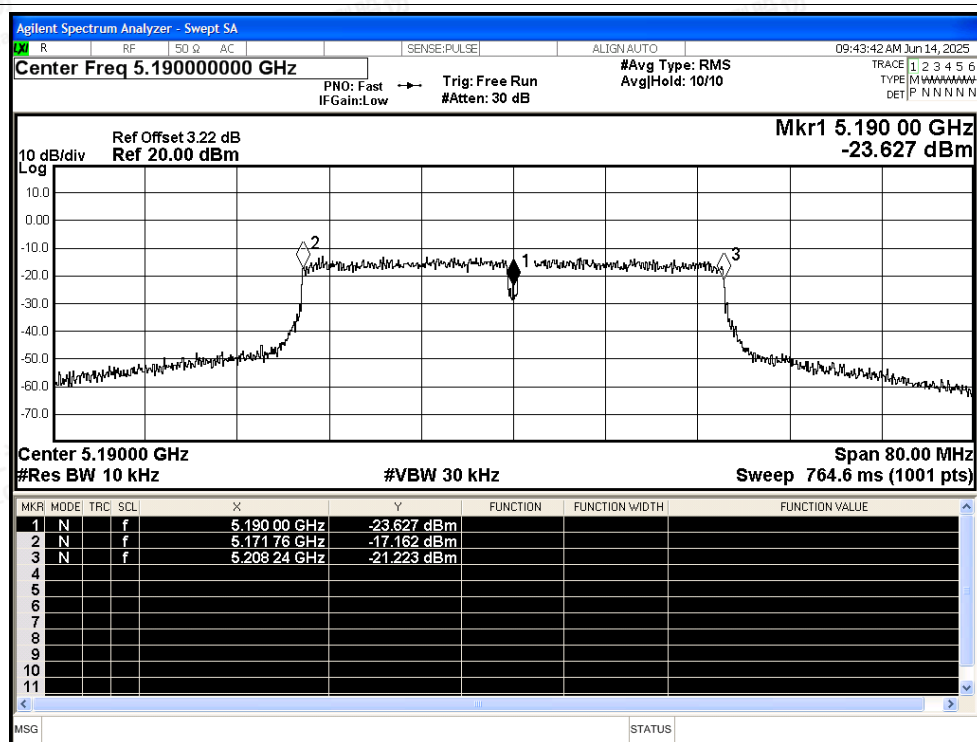

Freq. Stability NVNT n40 5230MHz Ant2

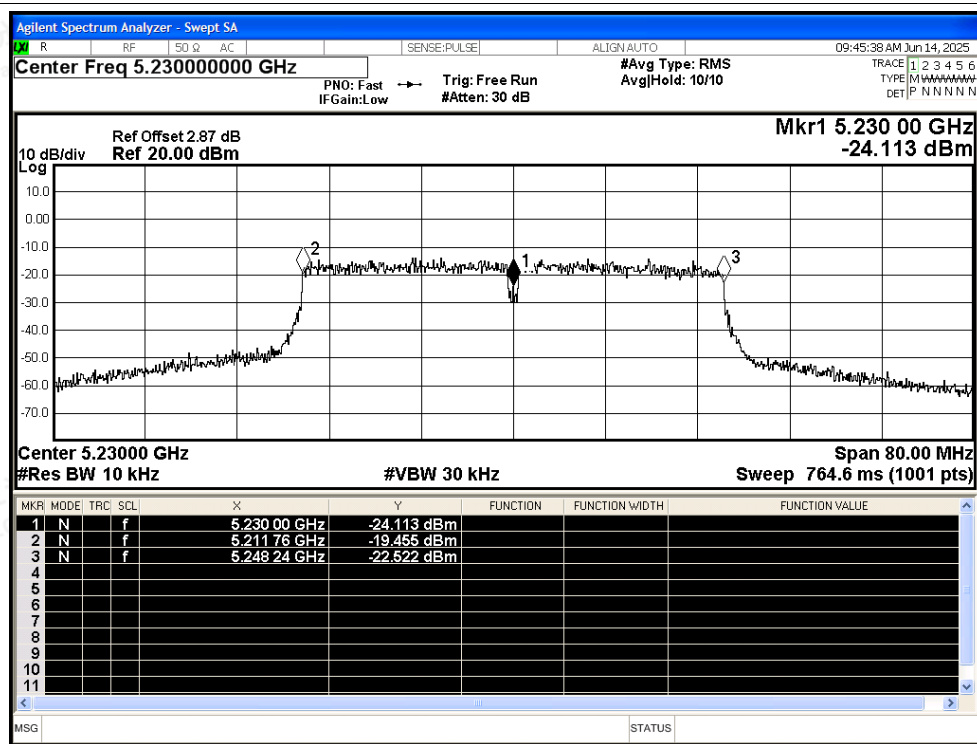

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant2

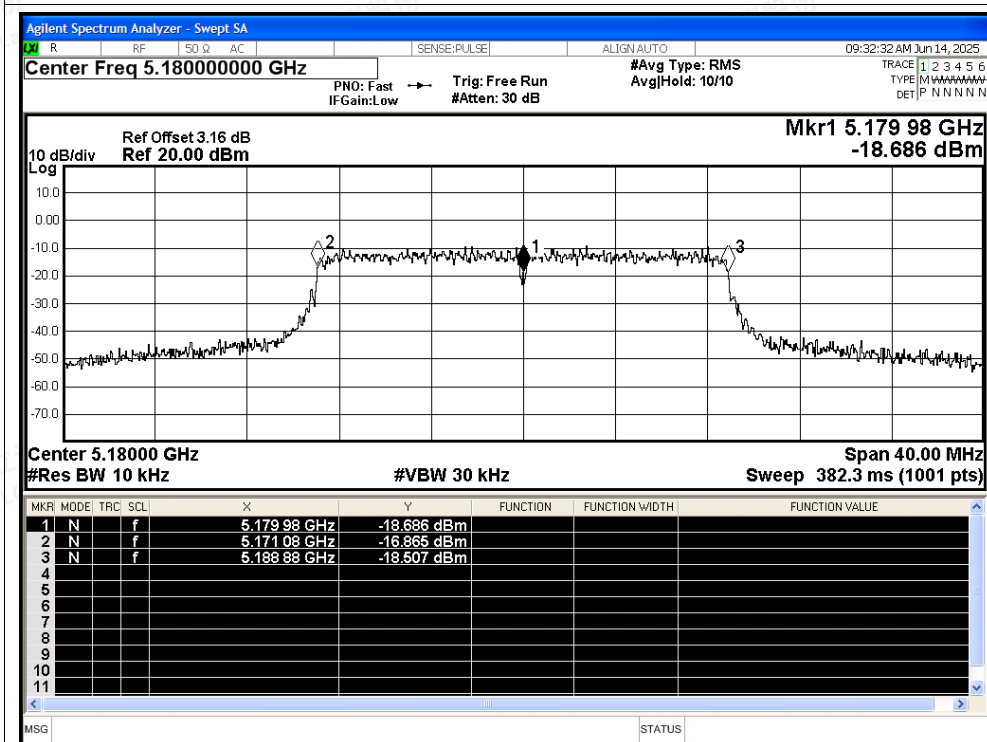

Freq. Stability NVNT ac20 5200MHz Ant2

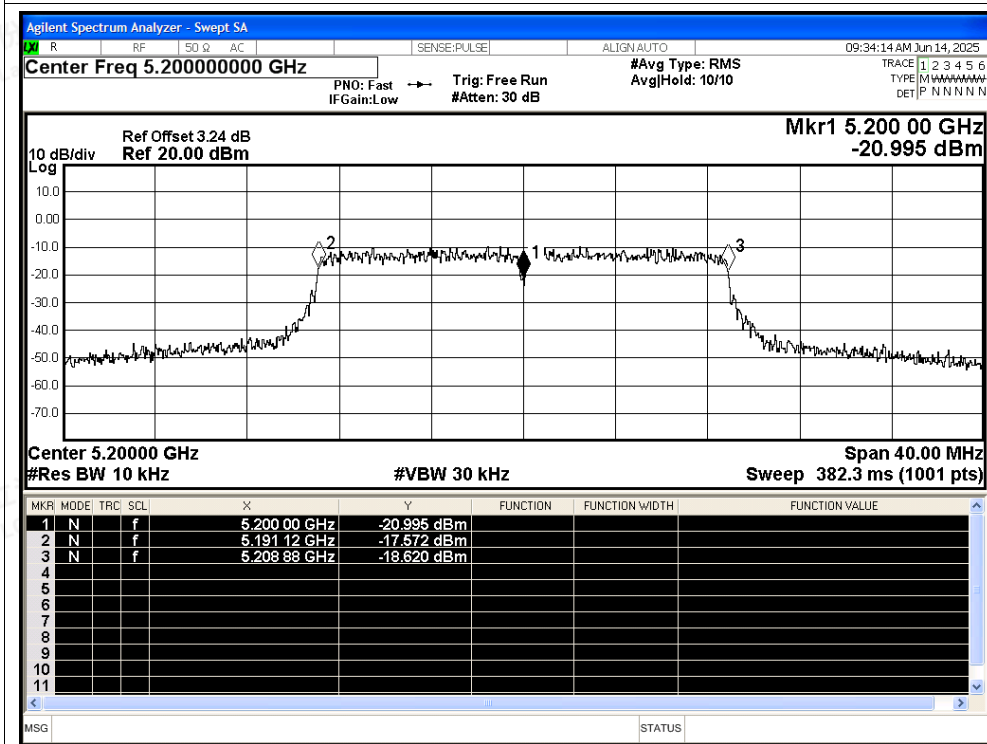

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant2

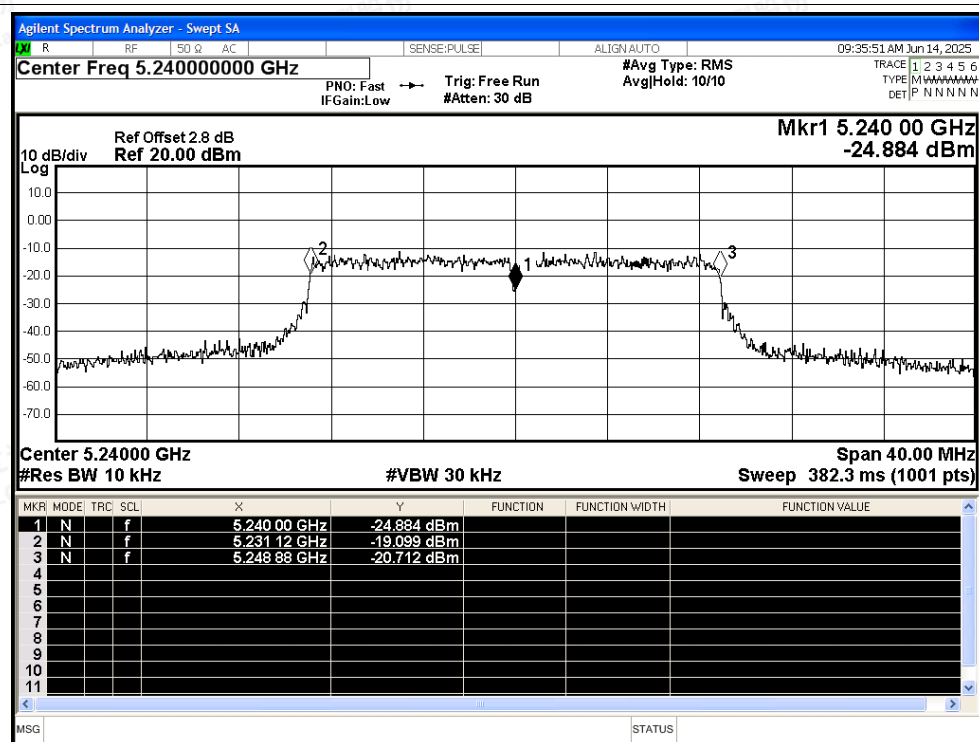

Freq. Stability NVNT ac40 5190MHz Ant2

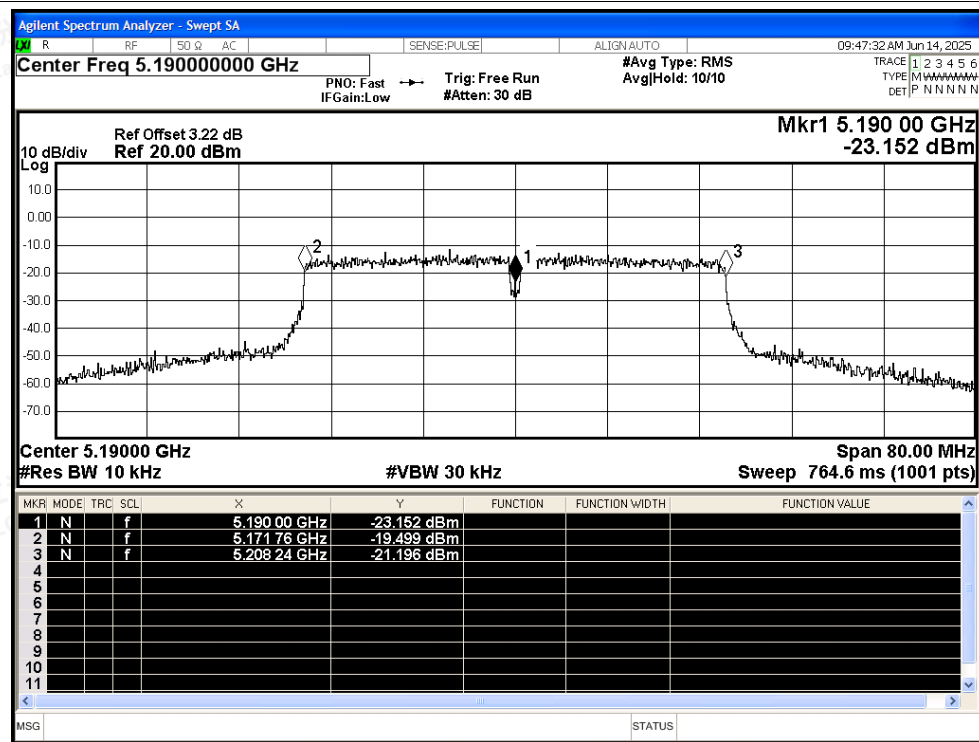

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant2

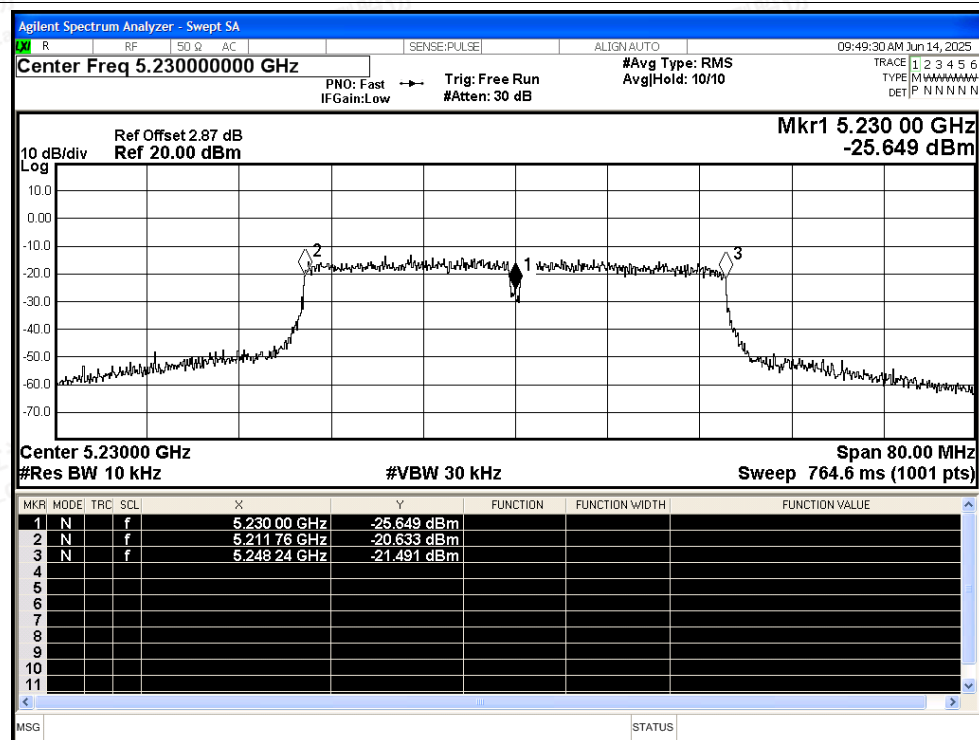

Freq. Stability NVNT ac80 5210MHz Ant2

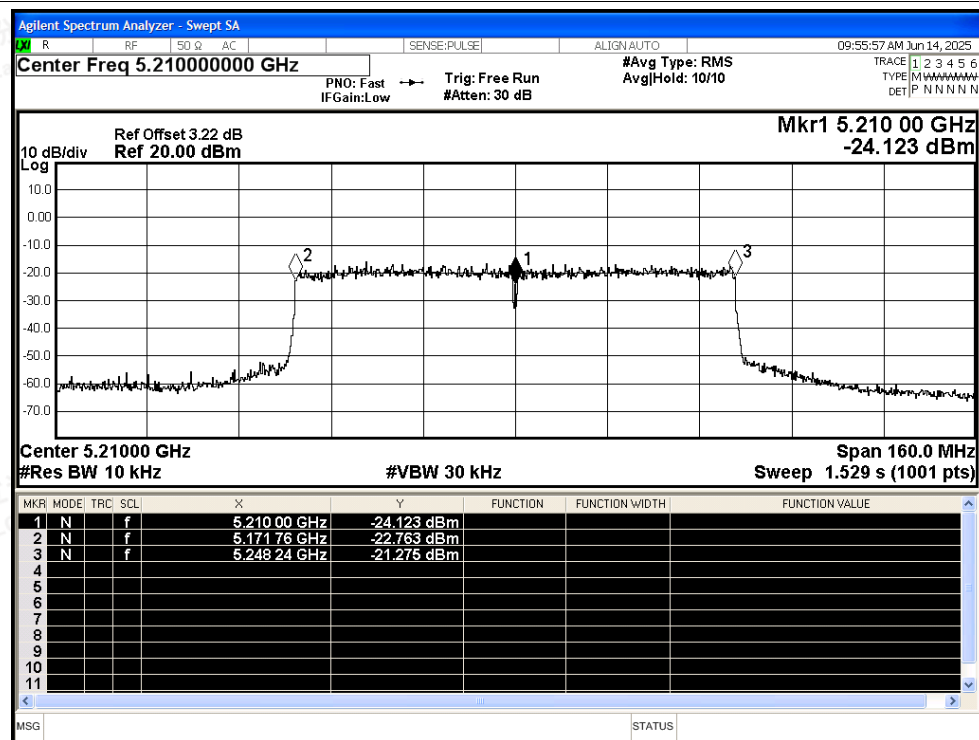

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant2

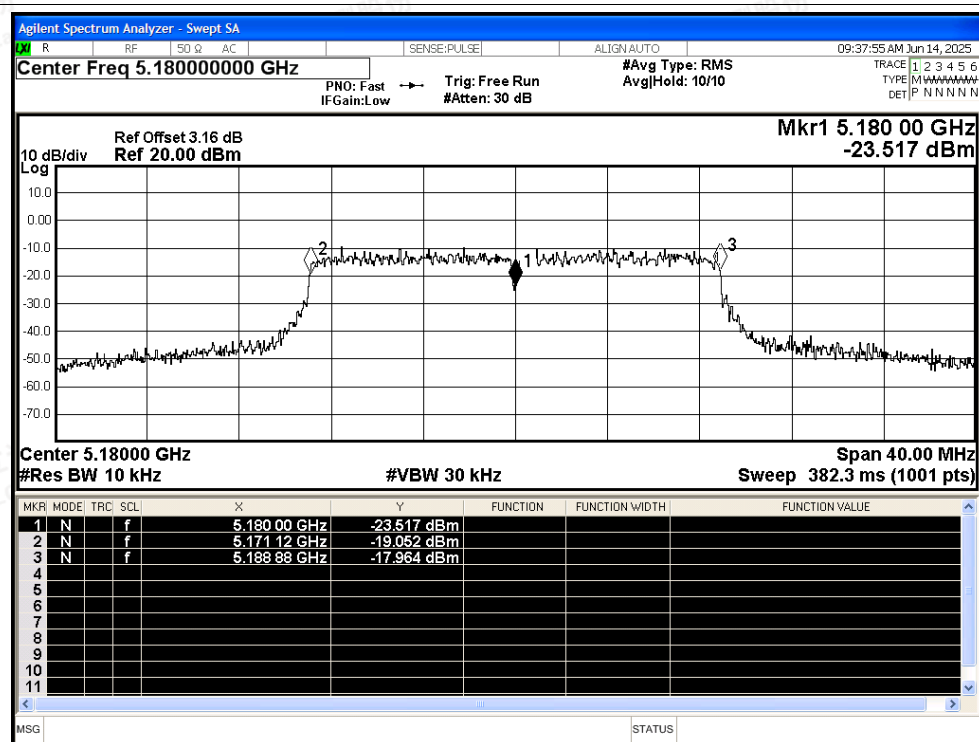

Freq. Stability NVNT ax20 5200MHz Ant2

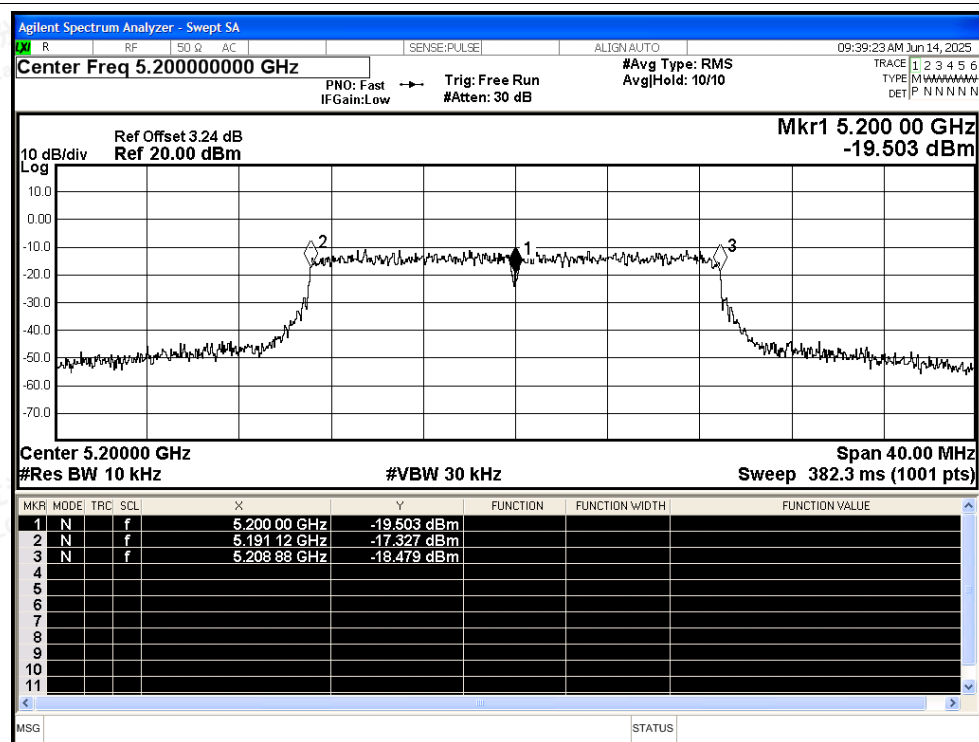

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant2

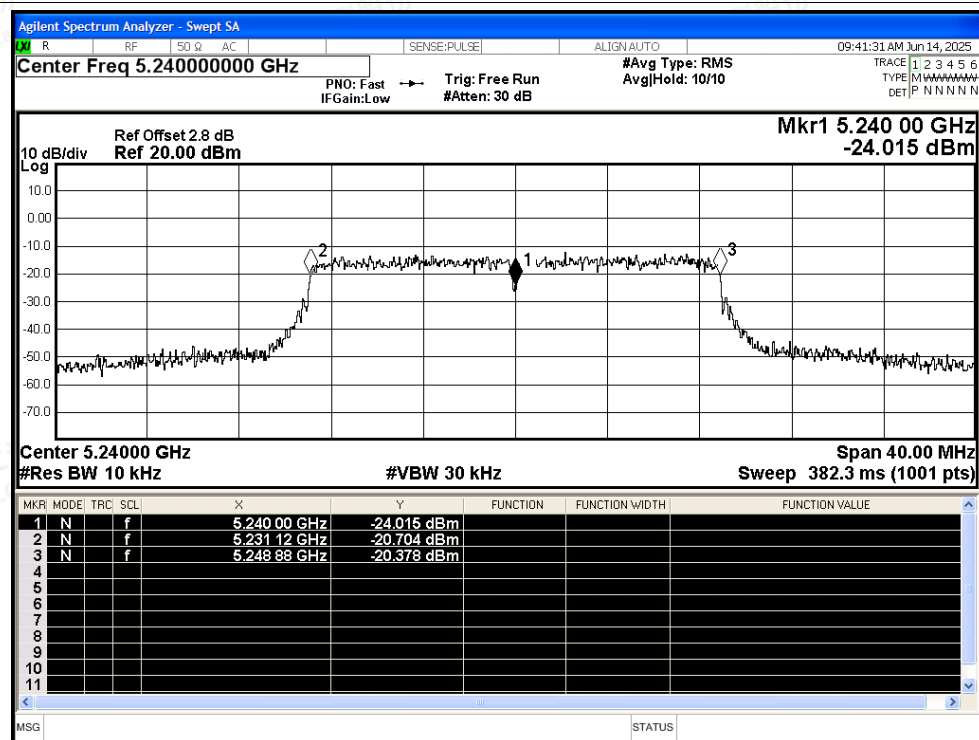

Freq. Stability NVNT ax40 5190MHz Ant2

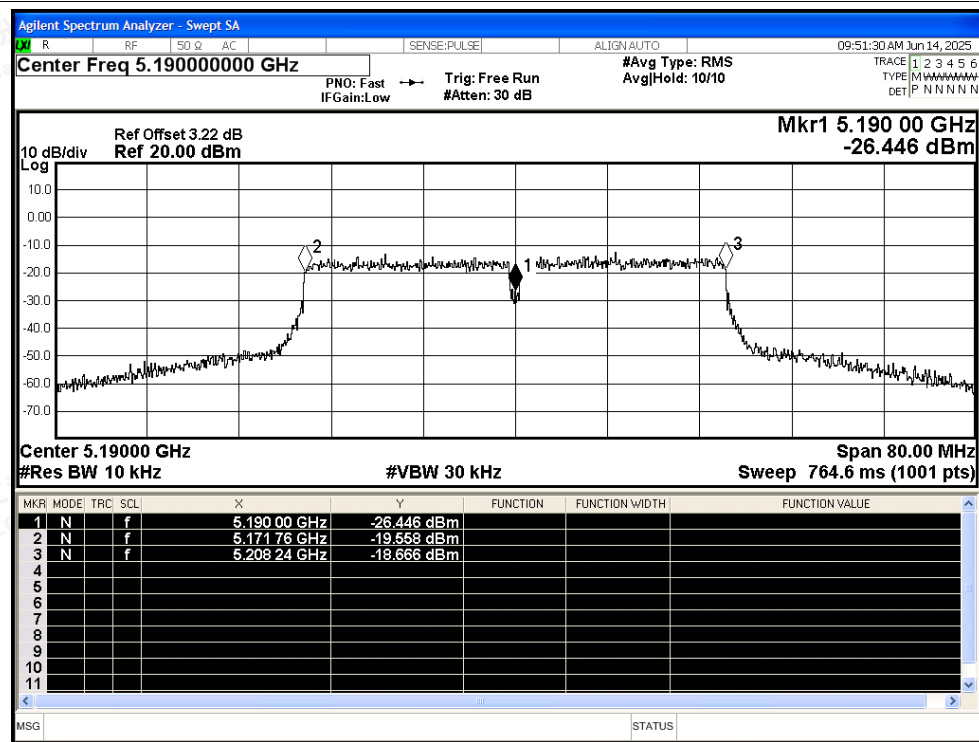

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant2

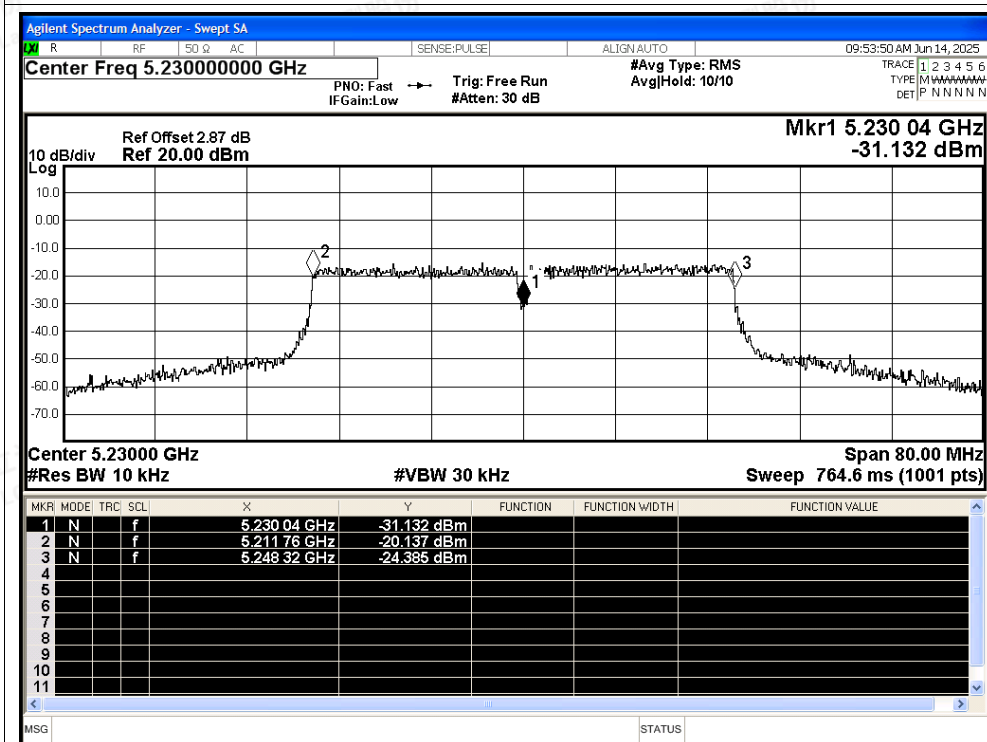

Freq. Stability NVNT ax80 5210MHz Ant2

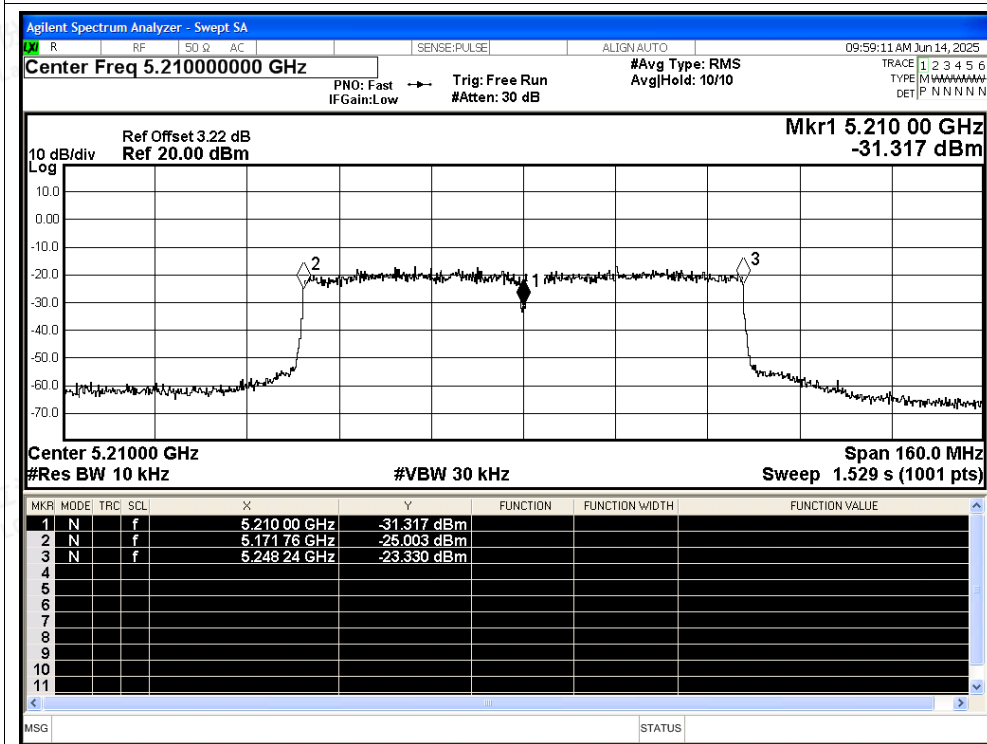

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.6 Duty Cycle

Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	95.75	0.19	0.72
NVNT	a	5200	Ant1	95.75	0.19	0.72
NVNT	a	5240	Ant1	95.68	0.19	0.72
NVNT	n20	5180	Ant1	94.94	0.23	0.85
NVNT	n20	5200	Ant1	94.94	0.23	0.85
NVNT	n20	5240	Ant1	94.94	0.23	0.85
NVNT	n40	5190	Ant1	90.45	0.44	1.7
NVNT	n40	5230	Ant1	90.45	0.44	1.7
NVNT	ac20	5180	Ant1	95.04	0.22	0.84
NVNT	ac20	5200	Ant1	95.04	0.22	0.84
NVNT	ac20	5240	Ant1	95.04	0.22	0.84
NVNT	ac40	5190	Ant1	90.41	0.44	1.68
NVNT	ac40	5230	Ant1	90.56	0.43	1.68
NVNT	ac80	5210	Ant1	82.96	0.81	3.37
NVNT	ax20	5180	Ant1	95.04	0.22	0.84
NVNT	ax20	5200	Ant1	95.04	0.22	0.84
NVNT	ax20	5240	Ant1	94.97	0.22	0.84
NVNT	ax40	5190	Ant1	90.56	0.43	1.68
NVNT	ax40	5230	Ant1	90.56	0.43	1.68
NVNT	ax80	5210	Ant1	82.68	0.83	3.38



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

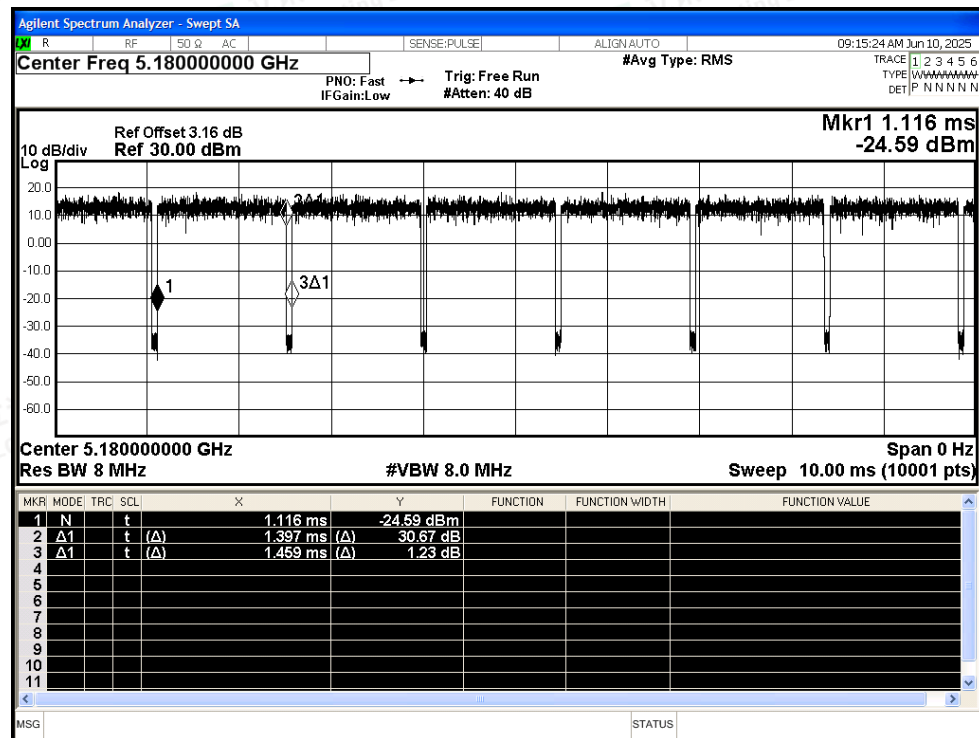

Duty Cycle NVNT a 5200MHz Ant1

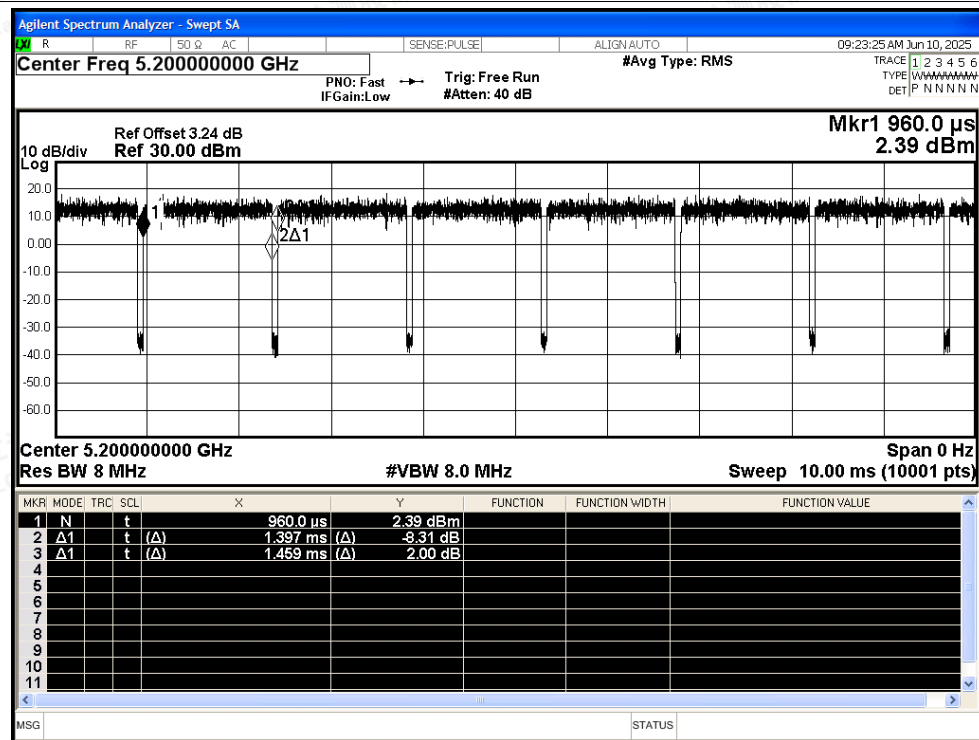

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant1

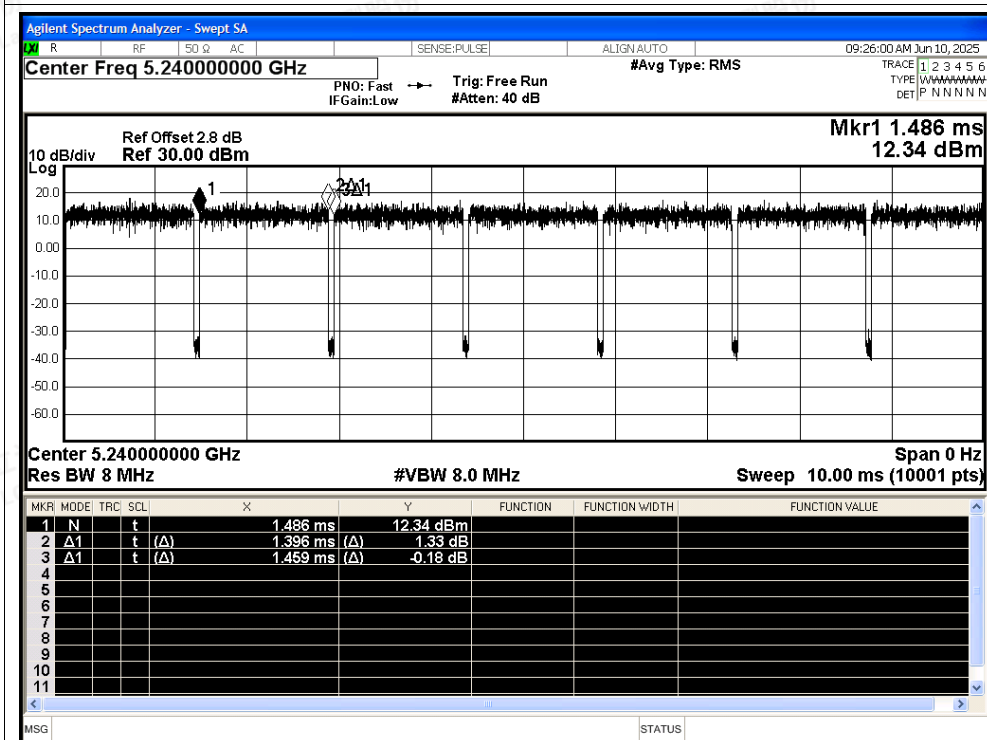

Duty Cycle NVNT n20 5180MHz Ant1

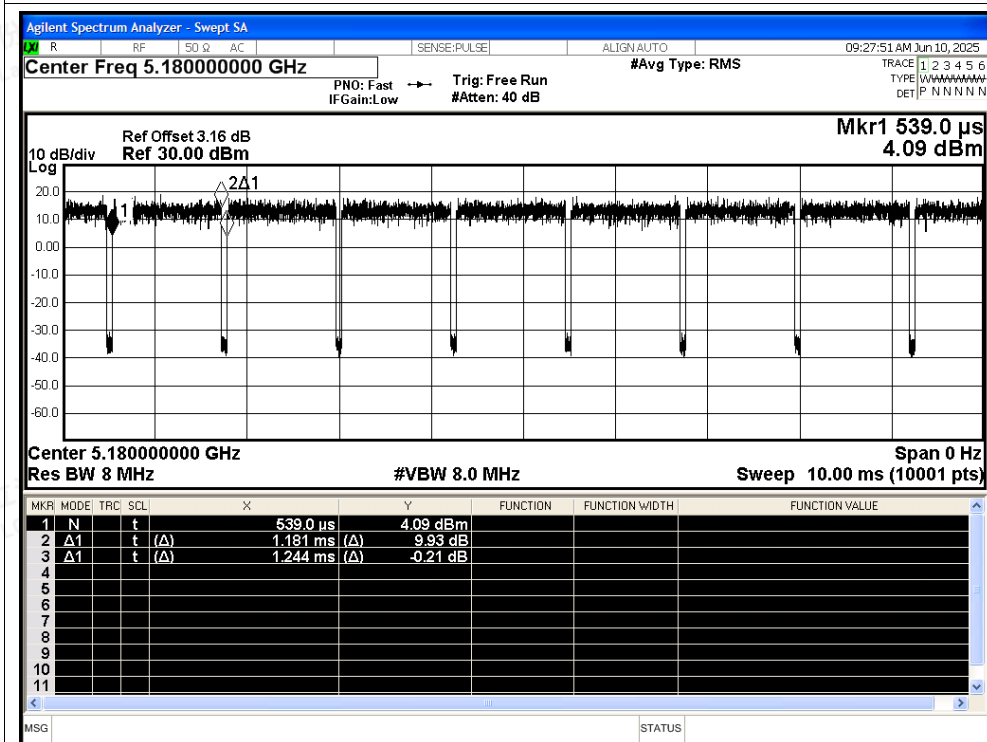

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant1

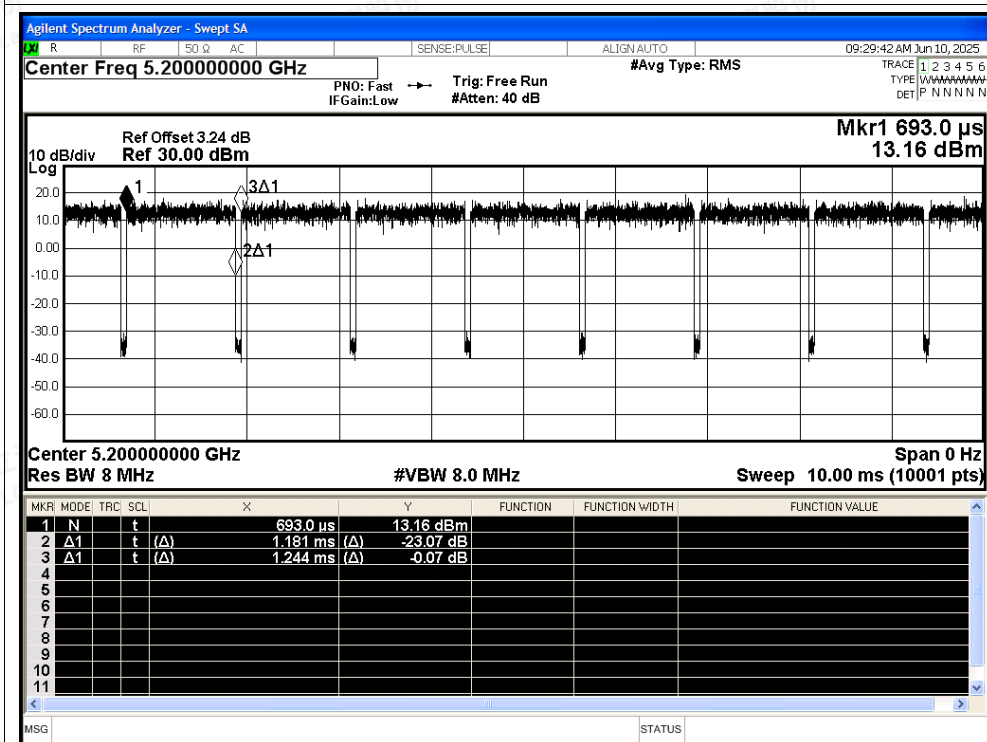

Duty Cycle NVNT n20 5240MHz Ant1

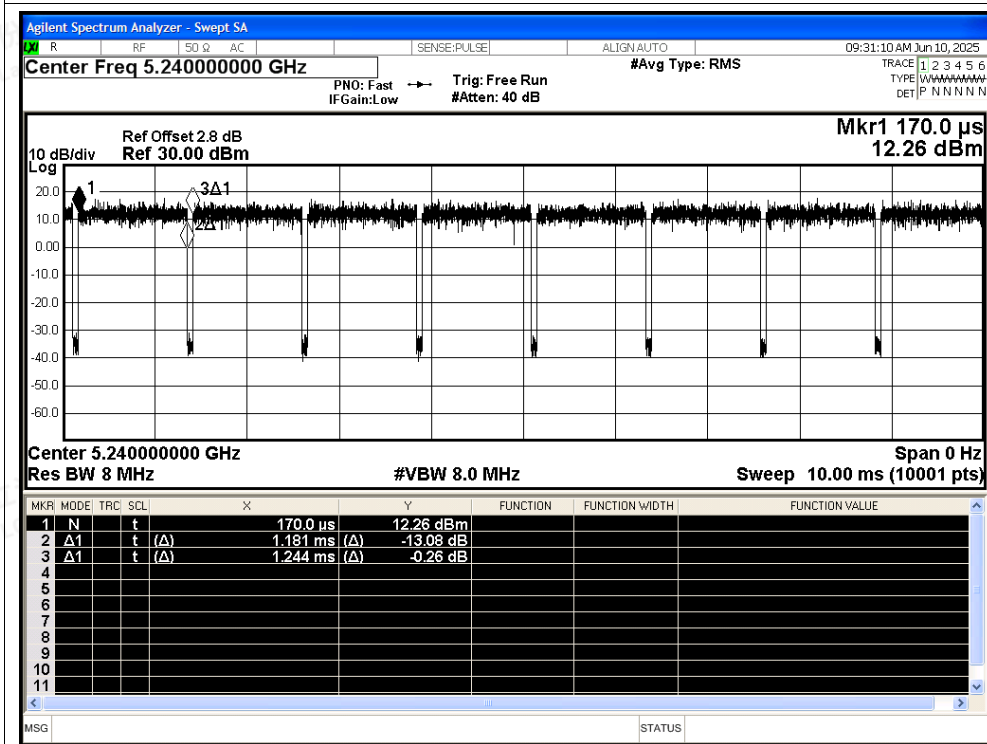

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant1

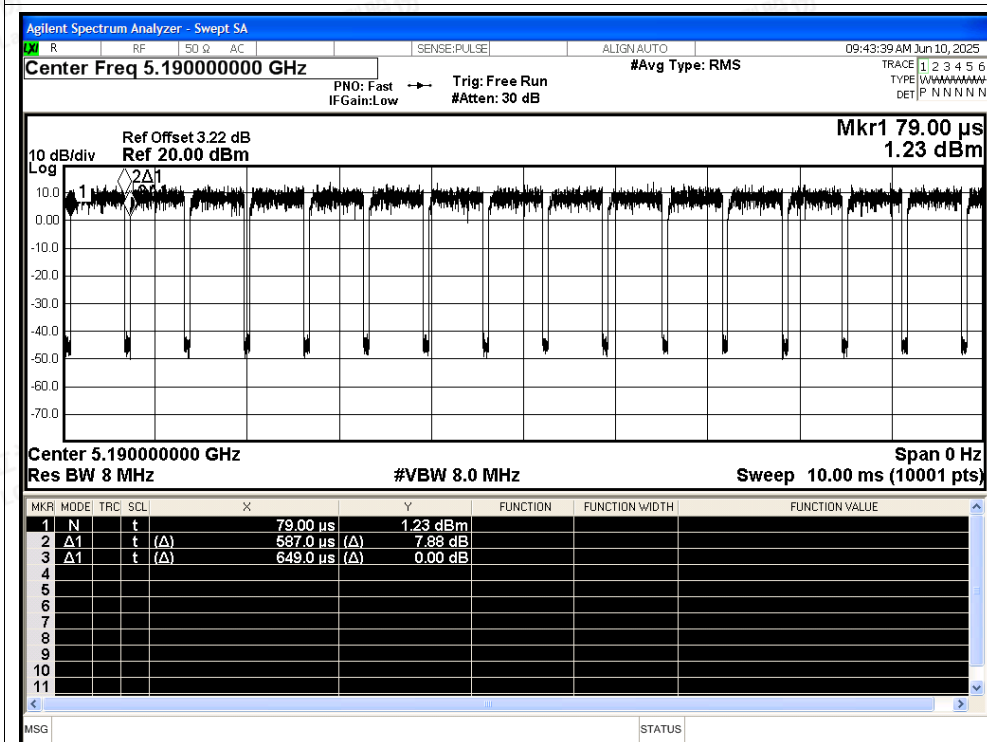

Duty Cycle NVNT n40 5230MHz Ant1

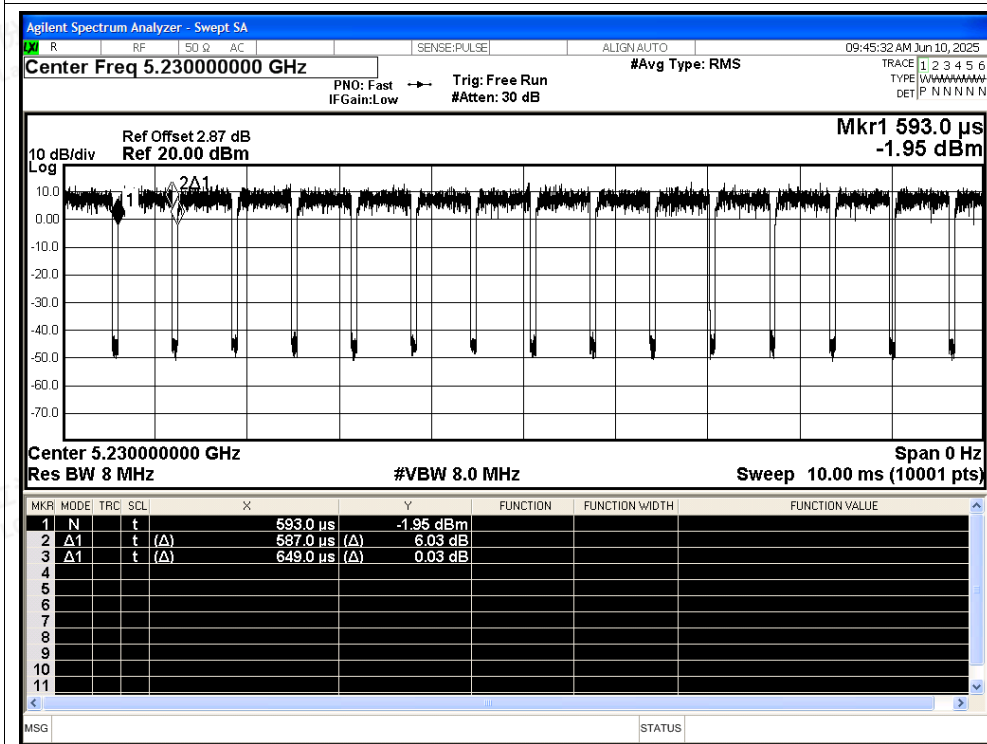

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant1

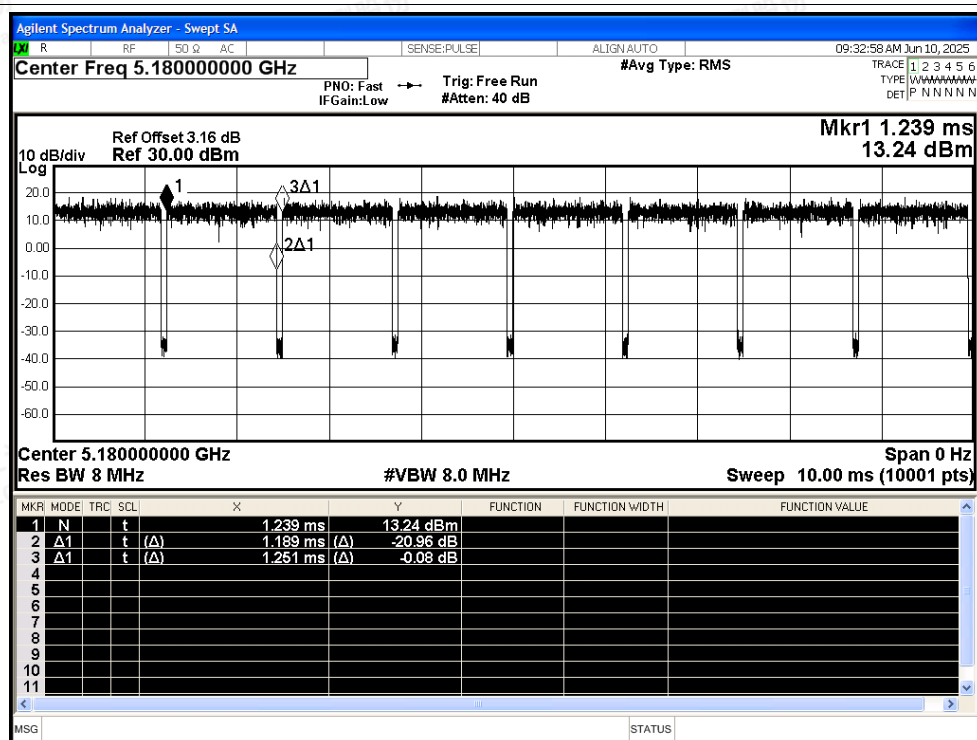

Duty Cycle NVNT ac20 5200MHz Ant1

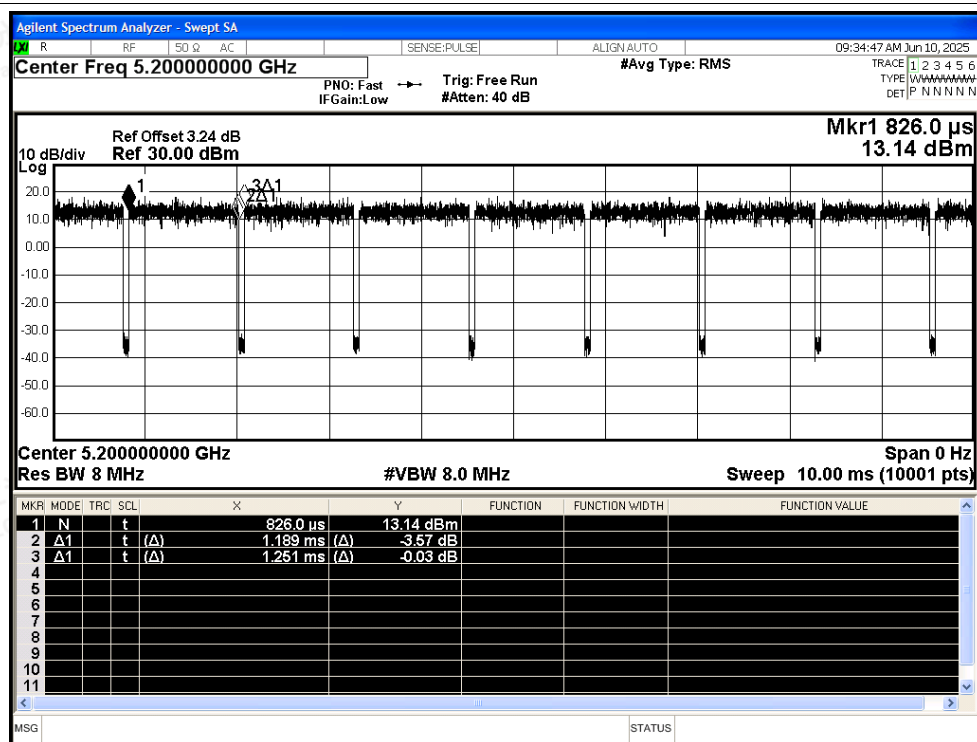

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant1

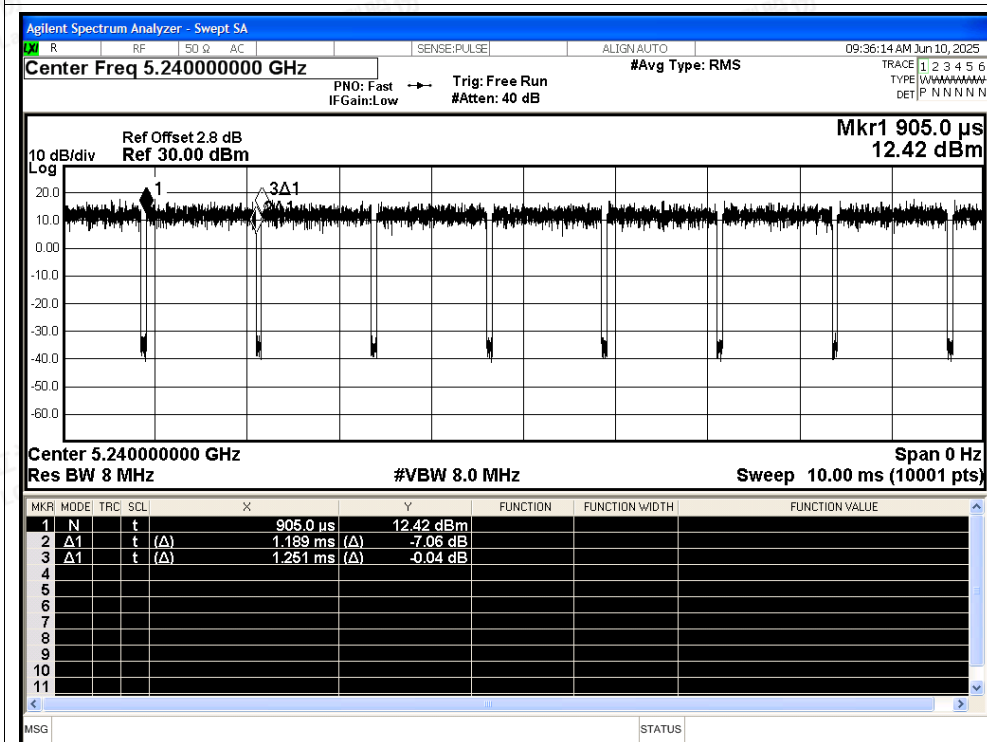

Duty Cycle NVNT ac40 5190MHz Ant1

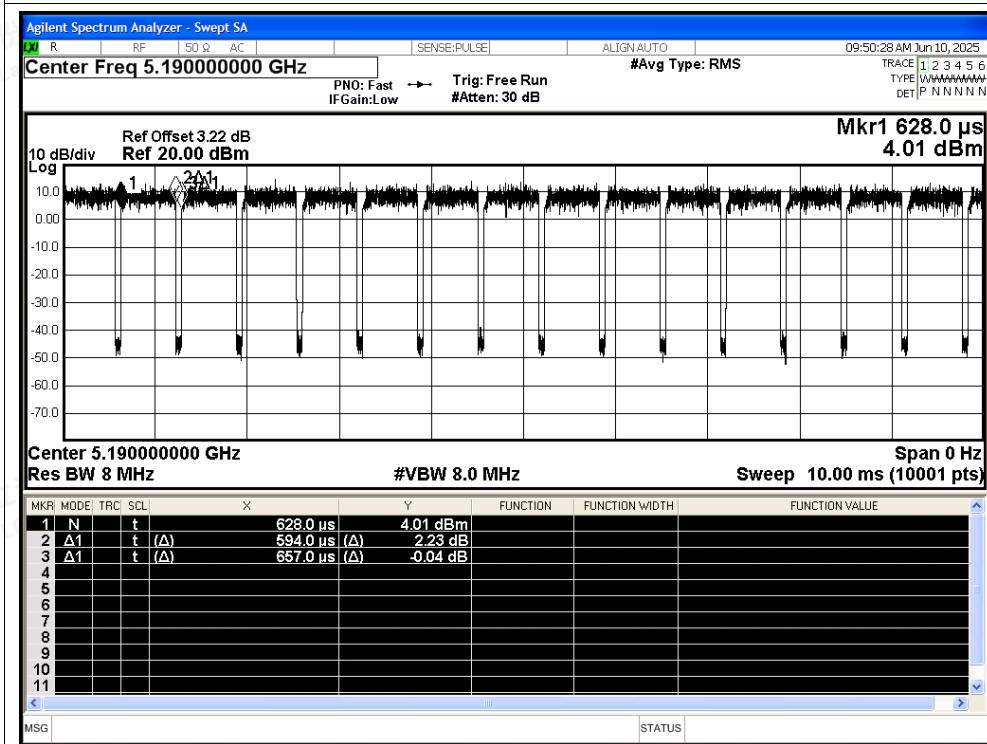

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant1

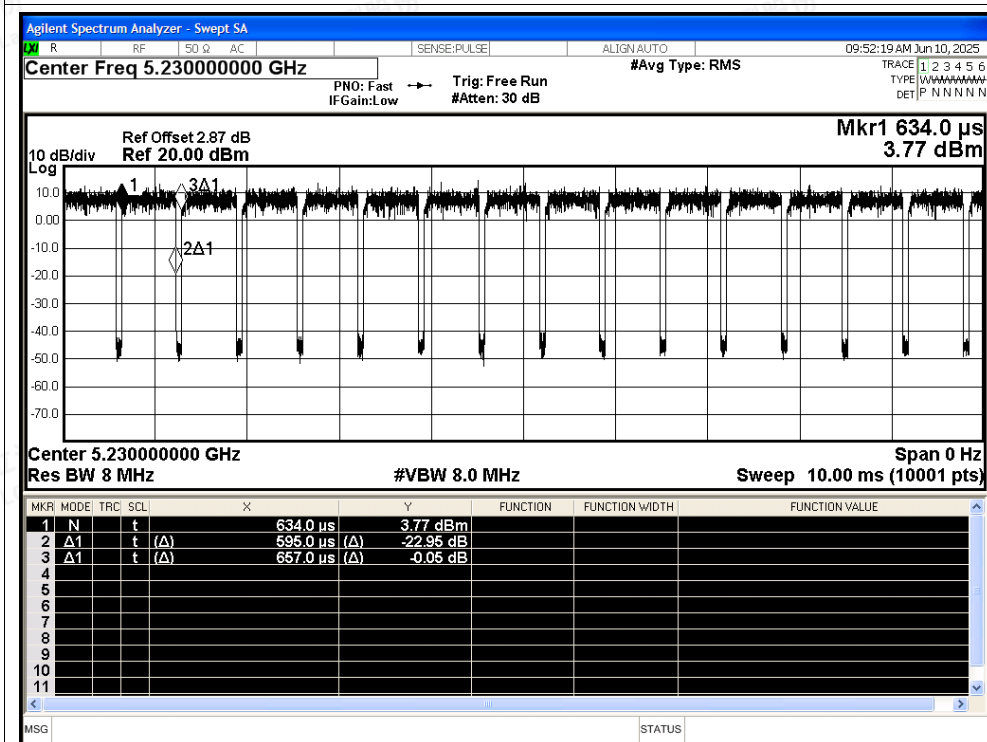

Duty Cycle NVNT ac80 5210MHz Ant1

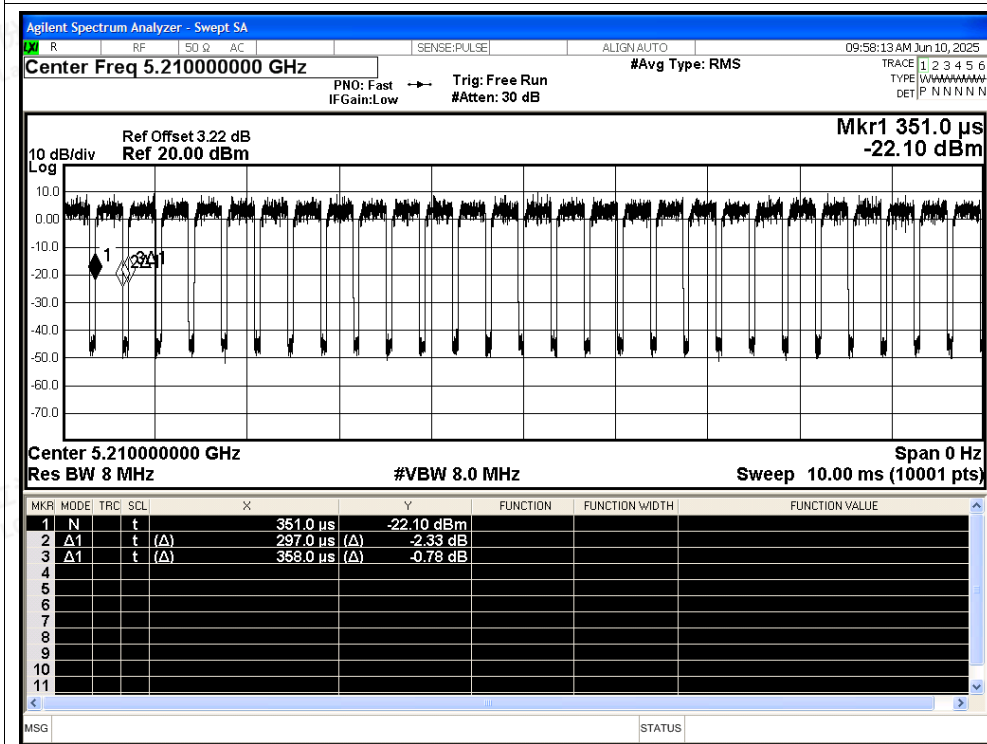

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant1

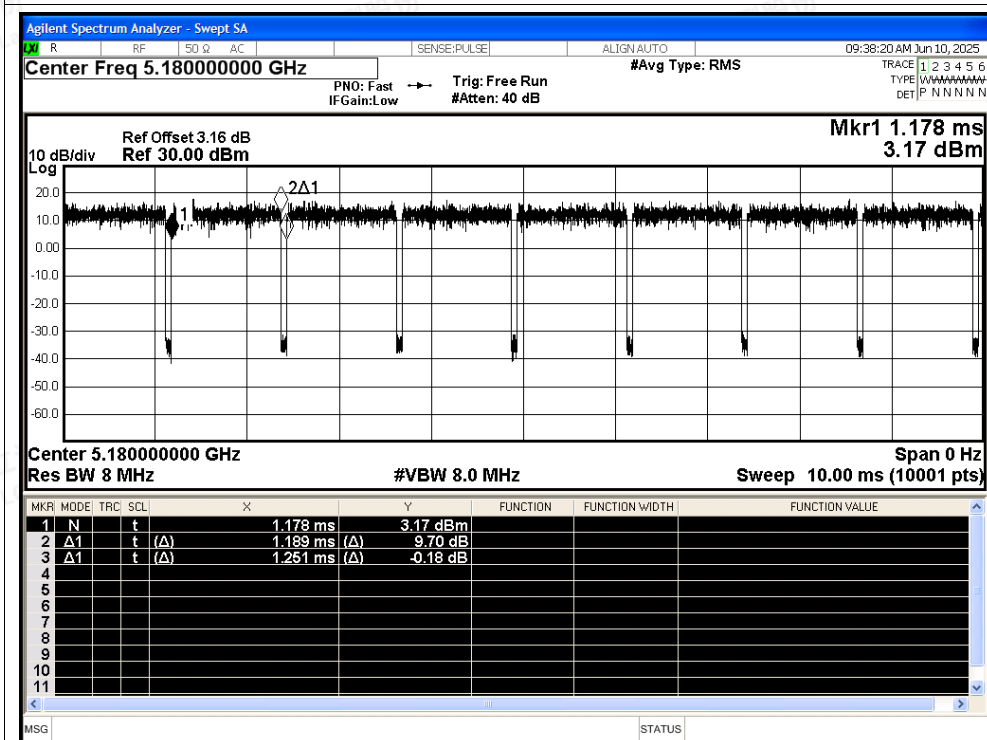

Duty Cycle NVNT ax20 5200MHz Ant1

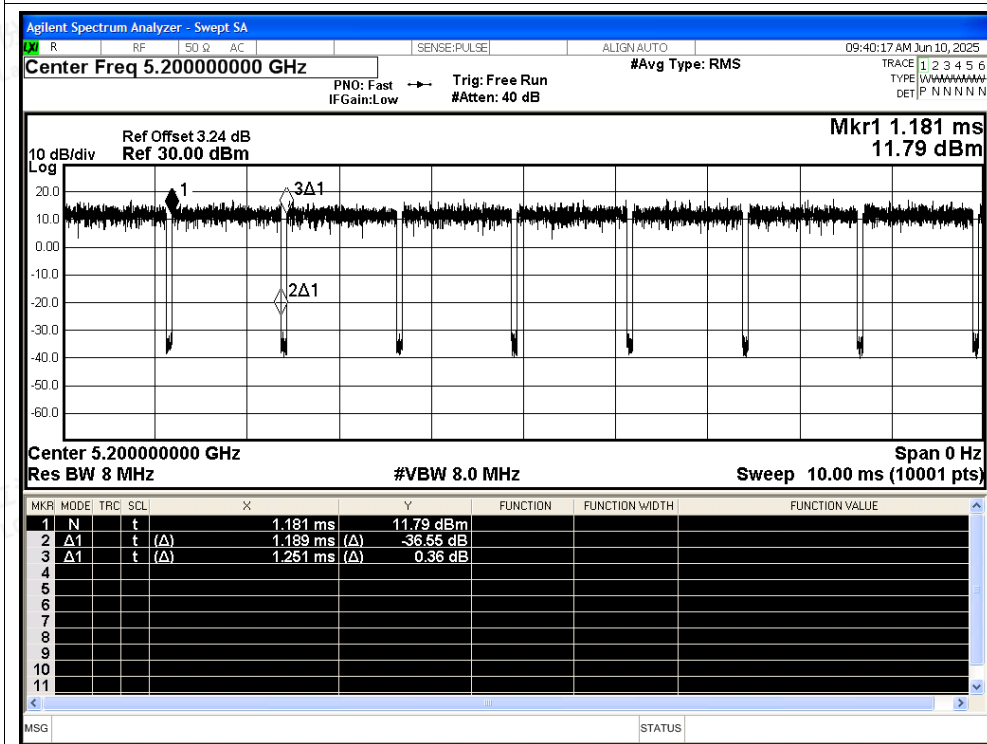

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant1

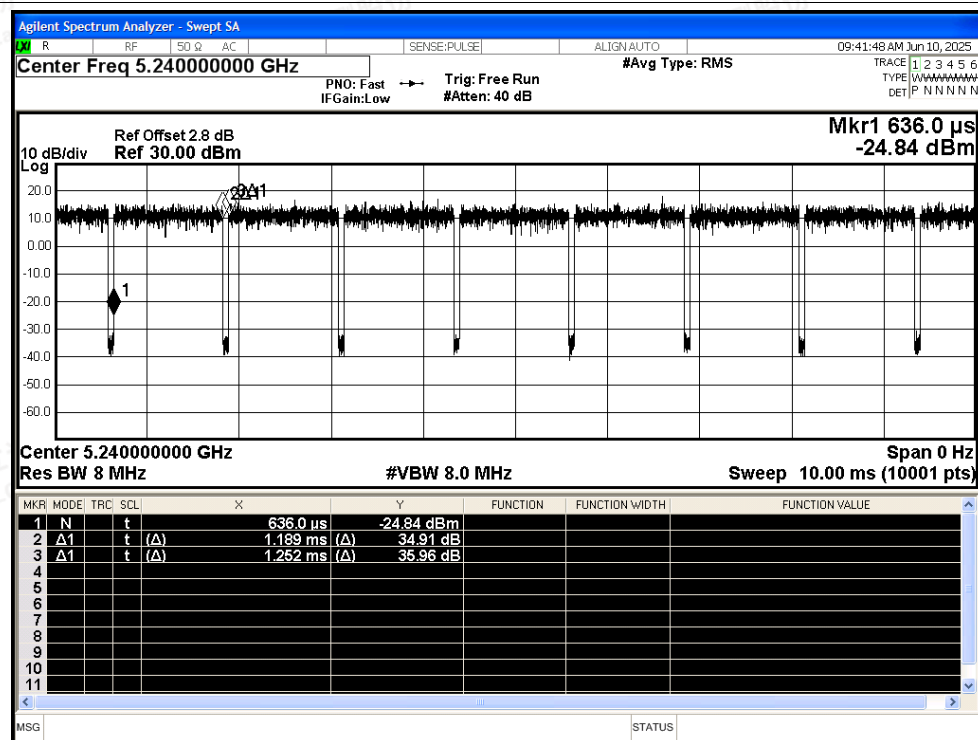

Duty Cycle NVNT ax40 5190MHz Ant1

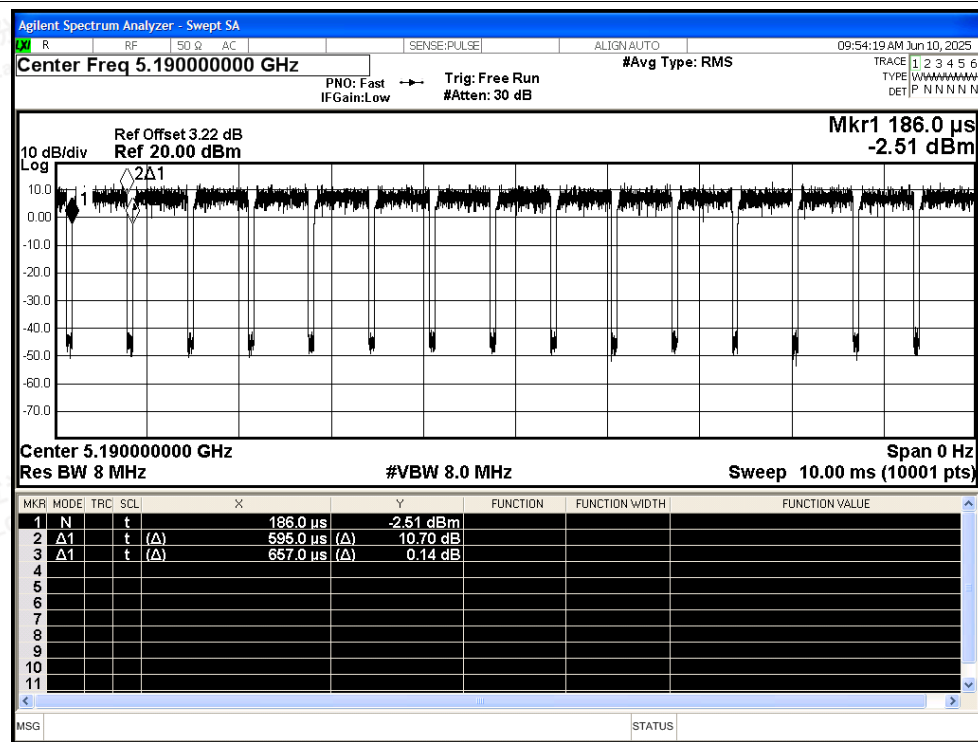

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant1

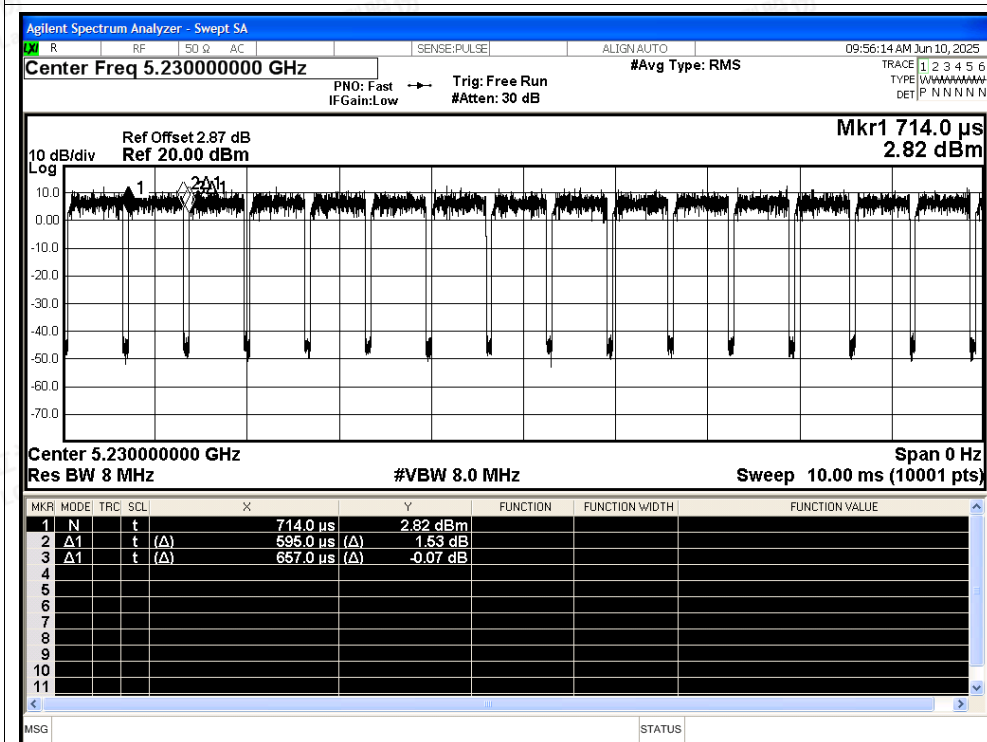

Duty Cycle NVNT ax80 5210MHz Ant1

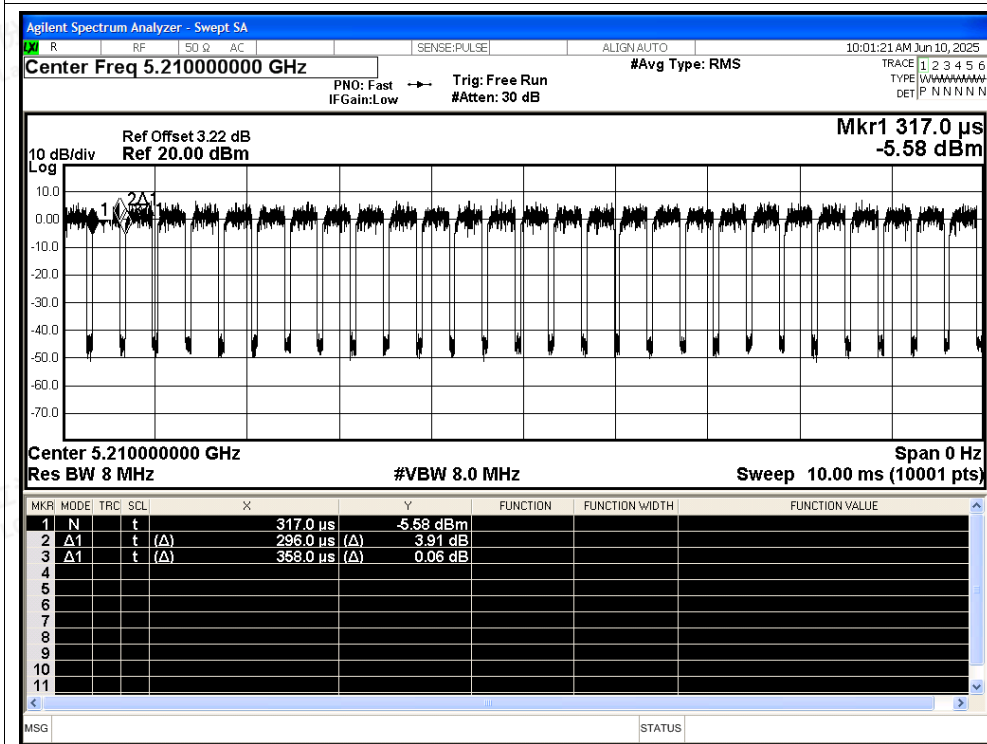

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	95.68	0.19	0.72
NVNT	a	5200	Ant2	95.68	0.19	0.72
NVNT	a	5240	Ant2	95.68	0.19	0.72
NVNT	n20	5180	Ant2	94.94	0.23	0.85
NVNT	n20	5200	Ant2	94.94	0.23	0.85
NVNT	n20	5240	Ant2	94.94	0.23	0.85
NVNT	n40	5190	Ant2	90.45	0.44	1.7
NVNT	n40	5230	Ant2	90.45	0.44	1.7
NVNT	ac20	5180	Ant2	95.04	0.22	0.84
NVNT	ac20	5200	Ant2	95.04	0.22	0.84
NVNT	ac20	5240	Ant2	94.96	0.22	0.84
NVNT	ac40	5190	Ant2	90.56	0.43	1.68
NVNT	ac40	5230	Ant2	90.41	0.44	1.68
NVNT	ac80	5210	Ant2	82.68	0.83	3.38
NVNT	ax20	5180	Ant2	95.04	0.22	0.84
NVNT	ax20	5200	Ant2	94.96	0.22	0.84
NVNT	ax20	5240	Ant2	95.04	0.22	0.84
NVNT	ax40	5190	Ant2	90.56	0.43	1.68
NVNT	ax40	5230	Ant2	90.56	0.43	1.68
NVNT	ax80	5210	Ant2	82.68	0.83	3.38






Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

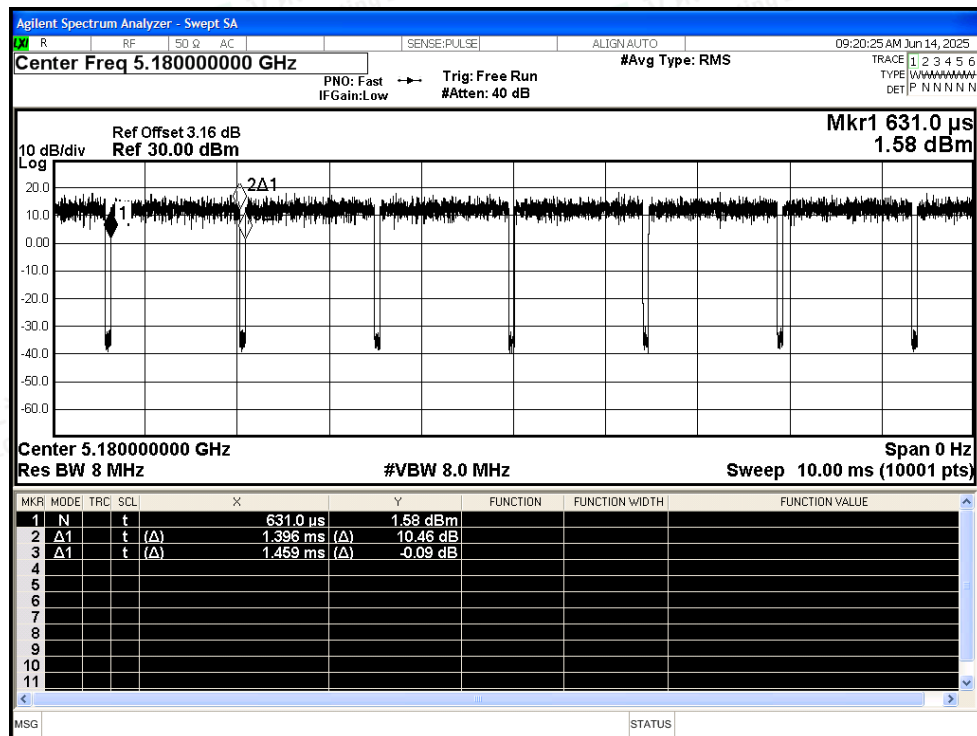

Duty Cycle NVNT a 5200MHz Ant2

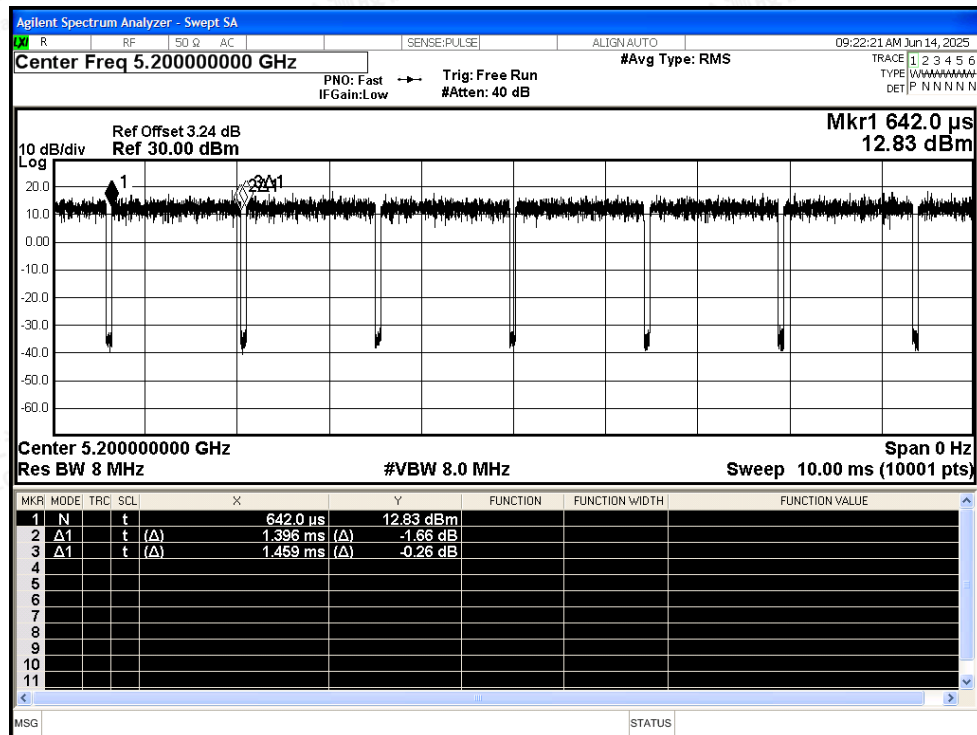

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5240MHz Ant2

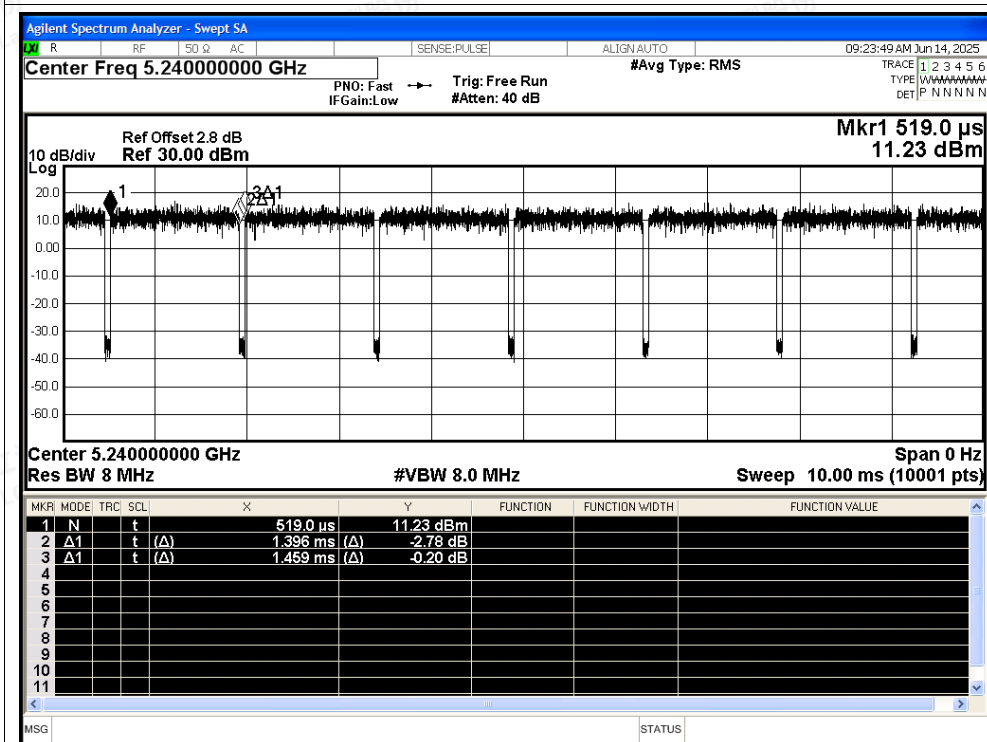

Duty Cycle NVNT n20 5180MHz Ant2

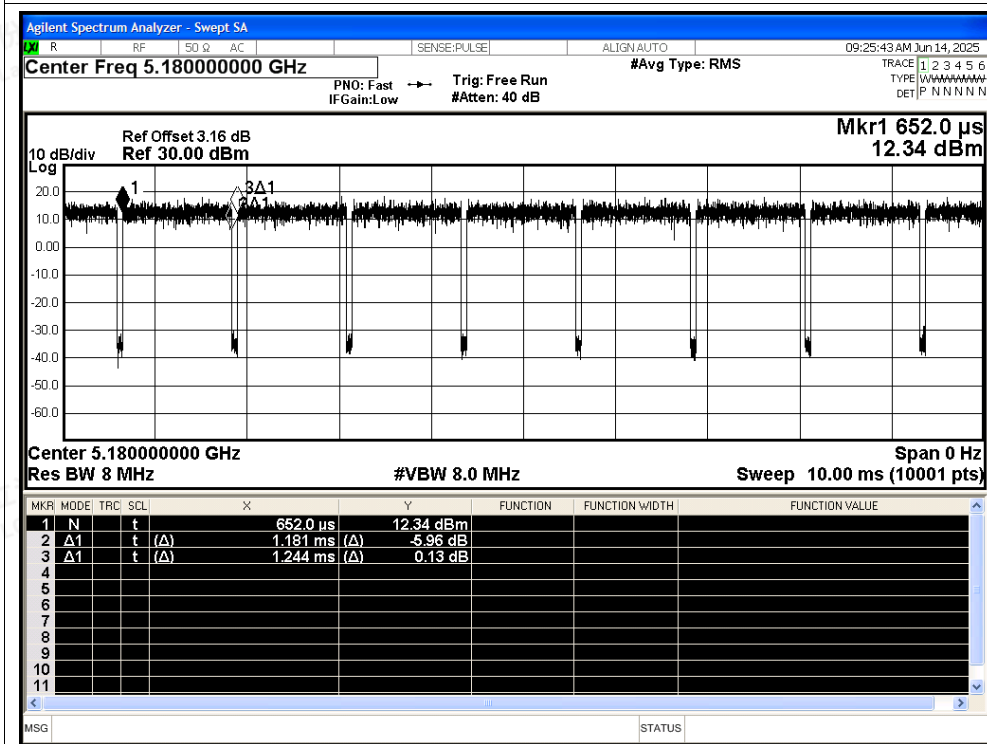

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5200MHz Ant2

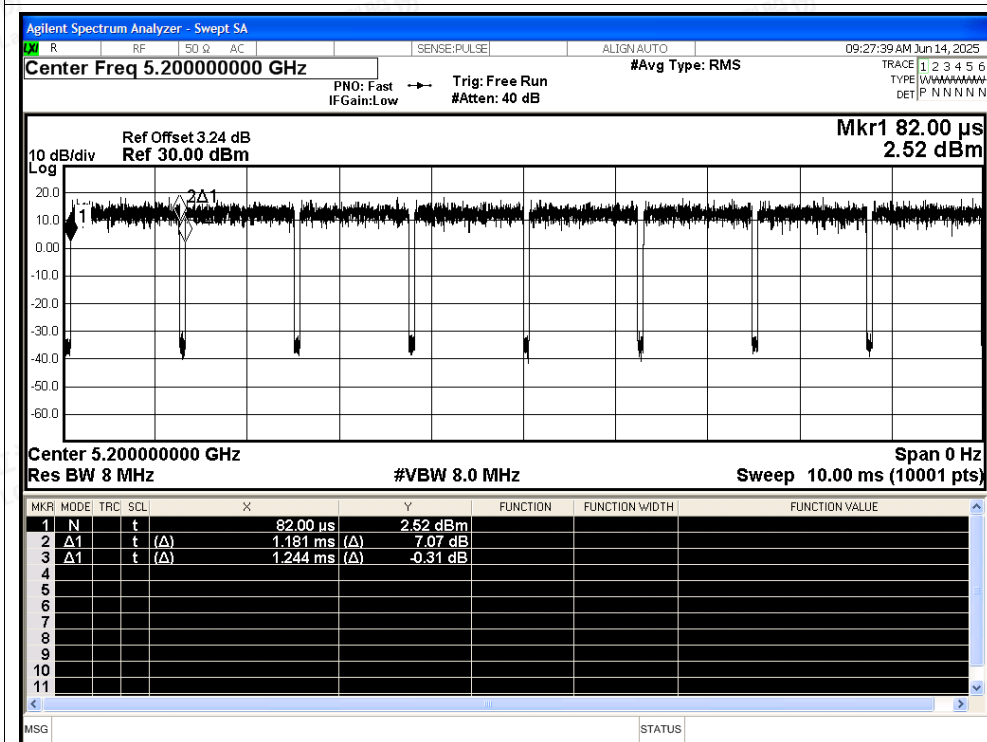

Duty Cycle NVNT n20 5240MHz Ant2

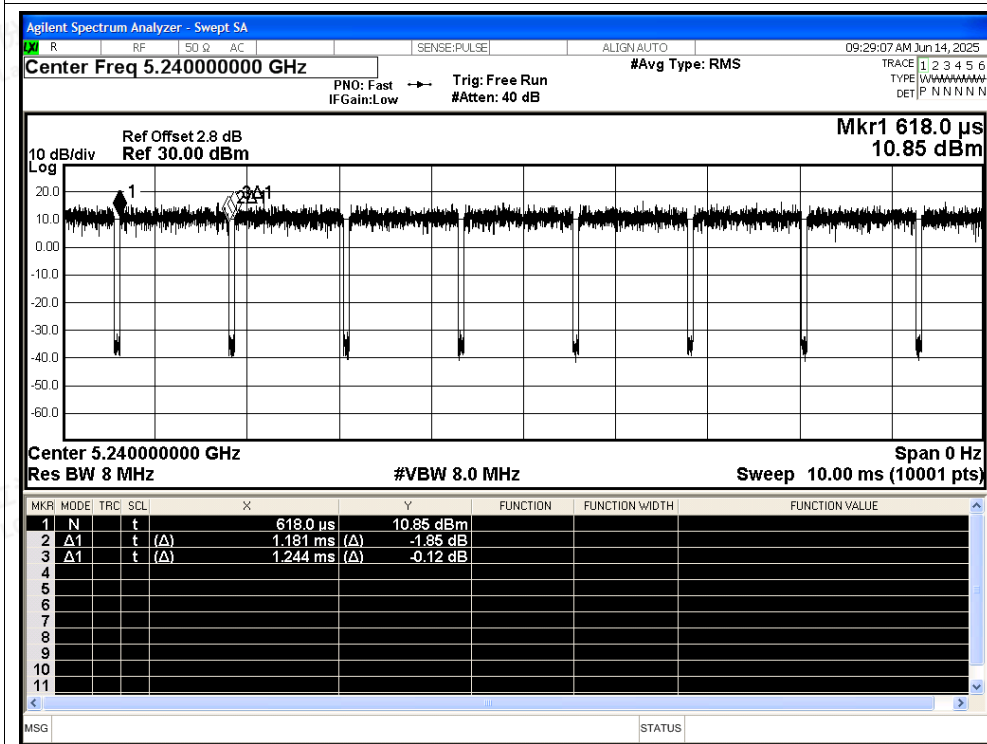

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5190MHz Ant2

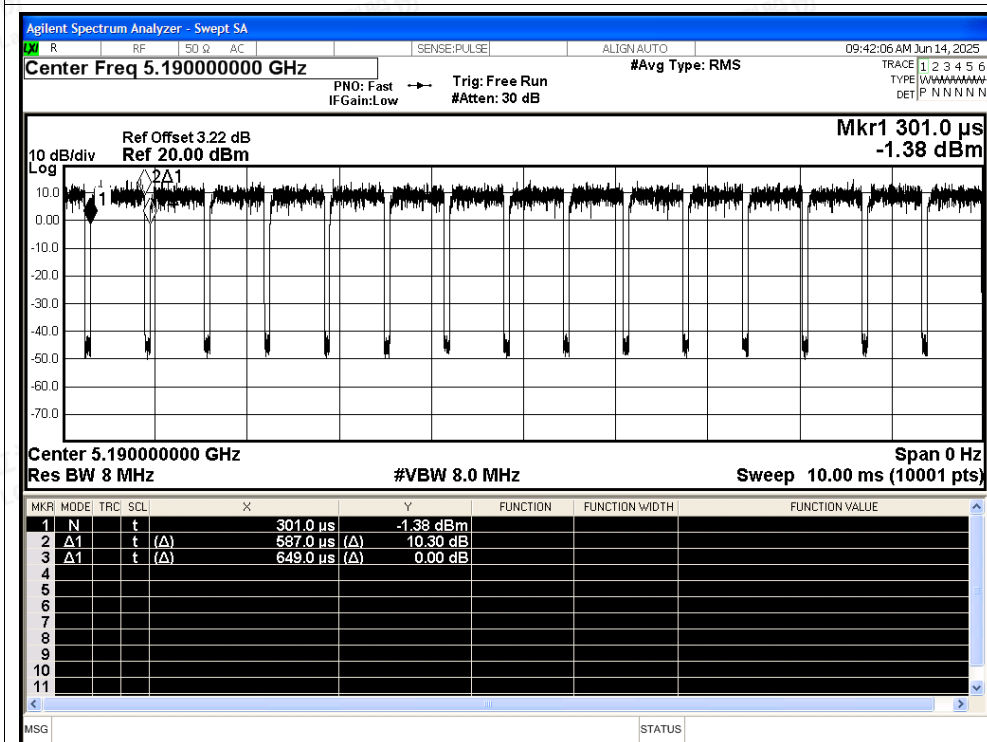

Duty Cycle NVNT n40 5230MHz Ant2

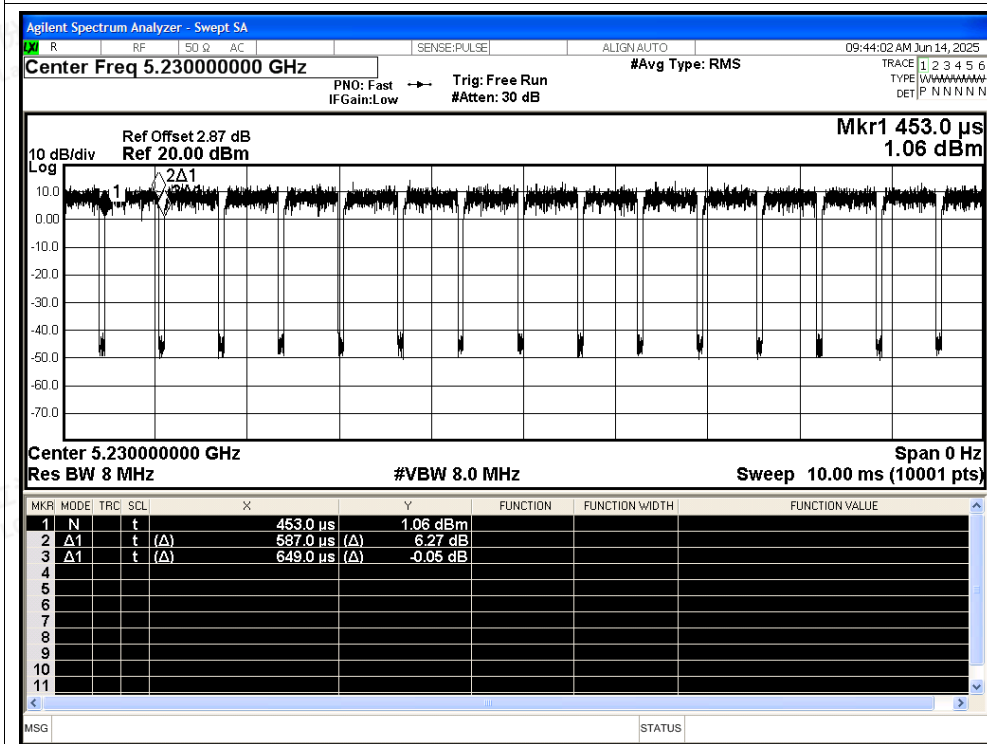

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5180MHz Ant2

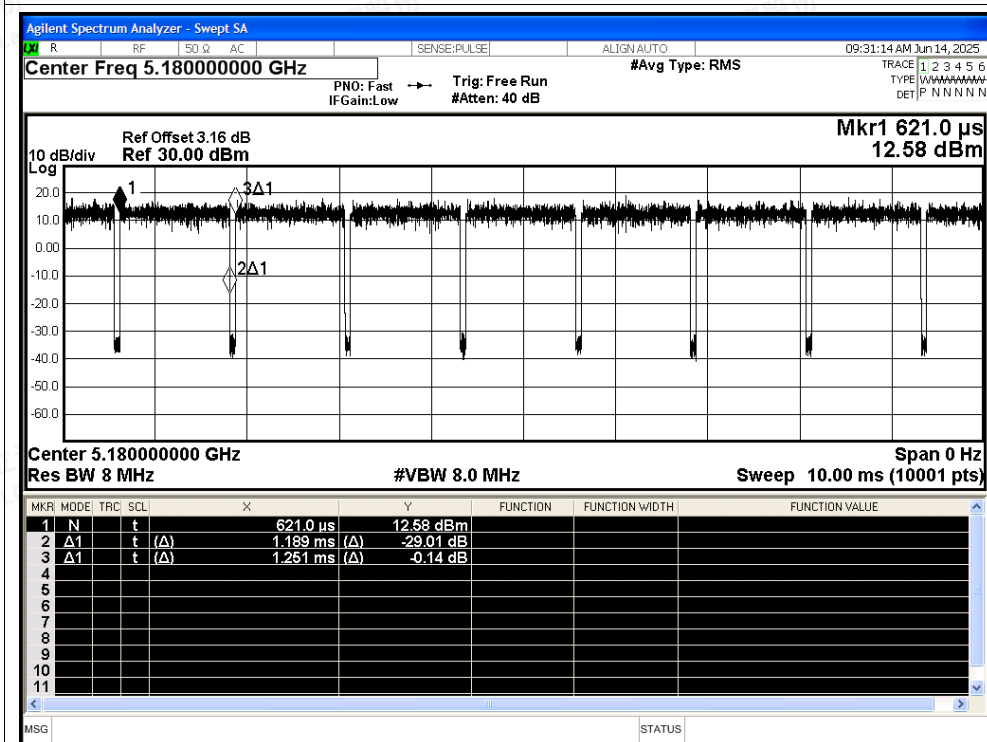

Duty Cycle NVNT ac20 5200MHz Ant2

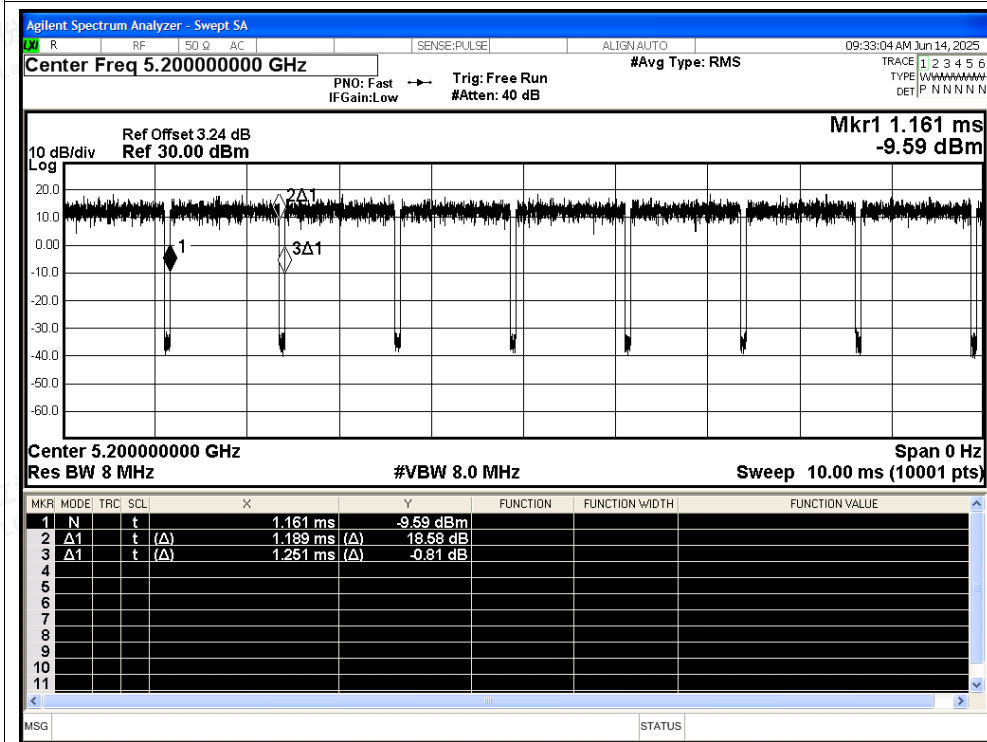

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5240MHz Ant2

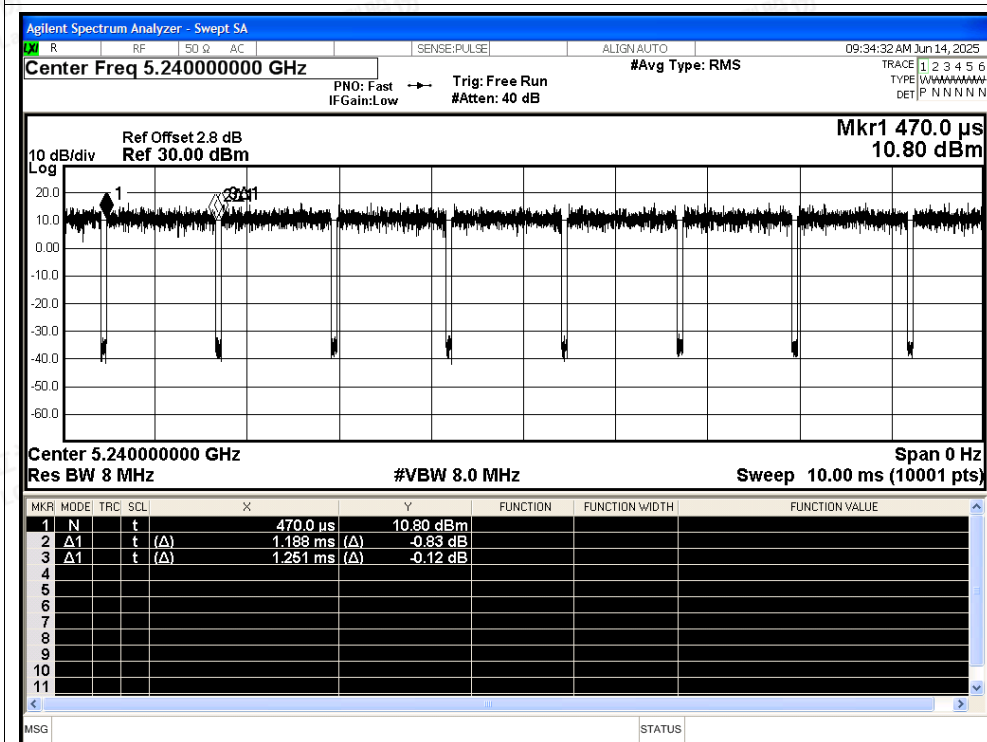

Duty Cycle NVNT ac40 5190MHz Ant2

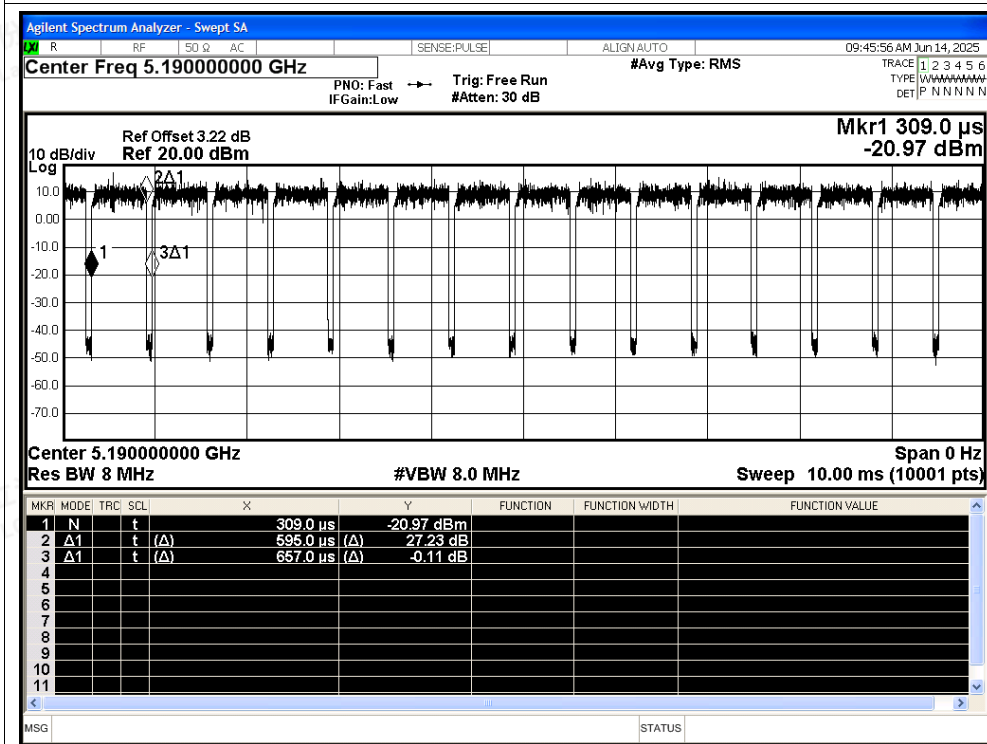

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5230MHz Ant2

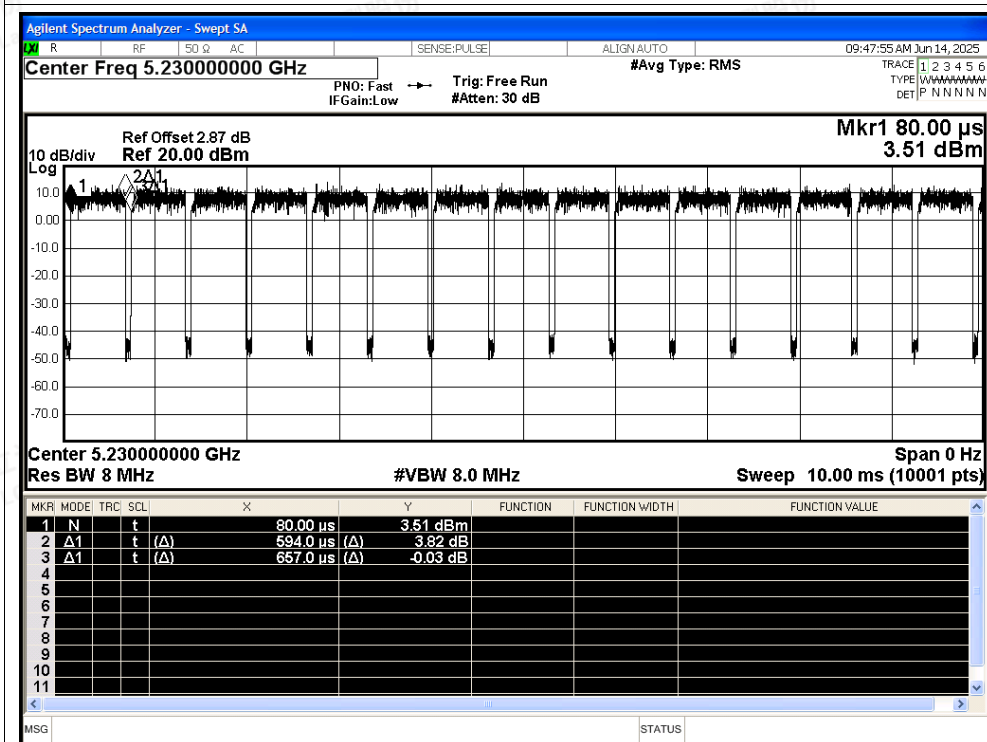

Duty Cycle NVNT ac80 5210MHz Ant2

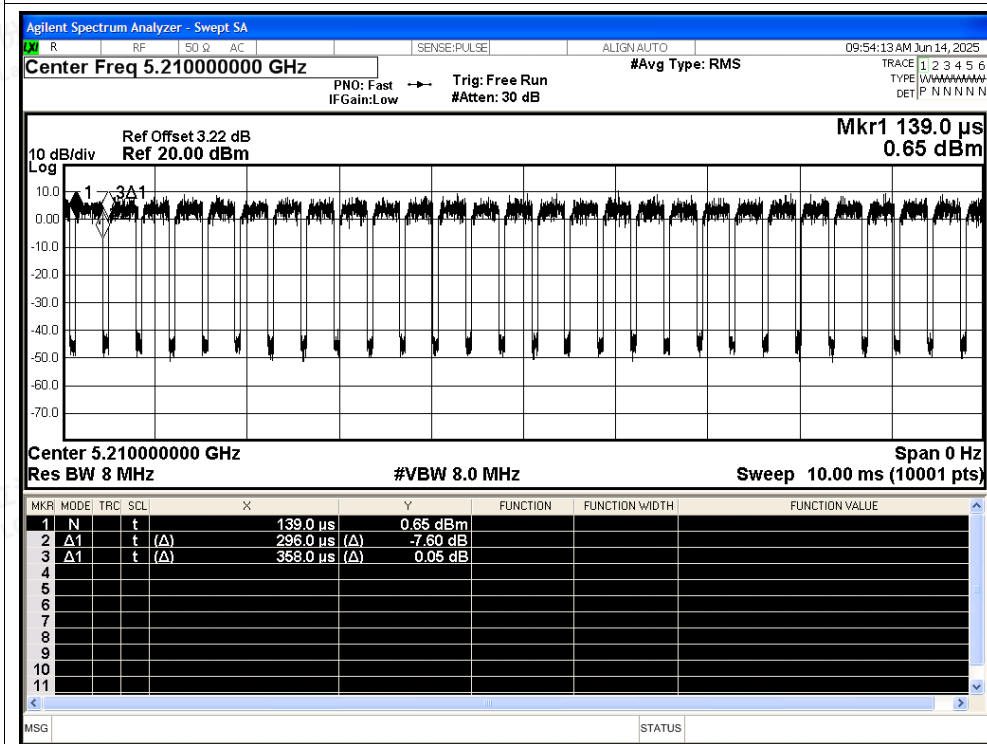

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5180MHz Ant2

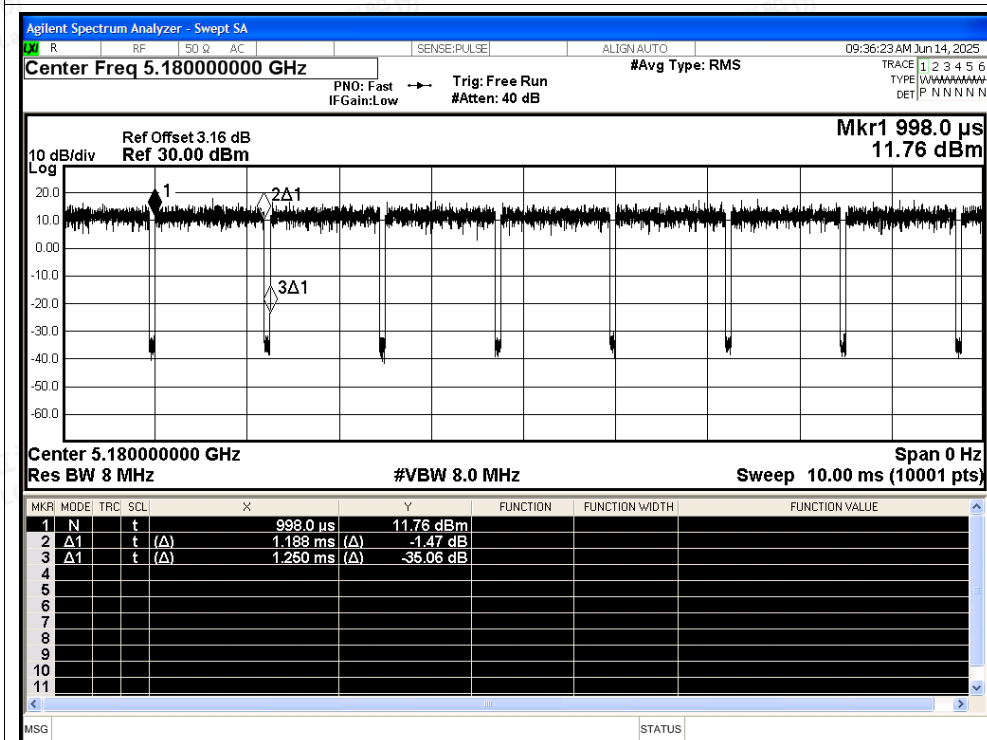

Duty Cycle NVNT ax20 5200MHz Ant2

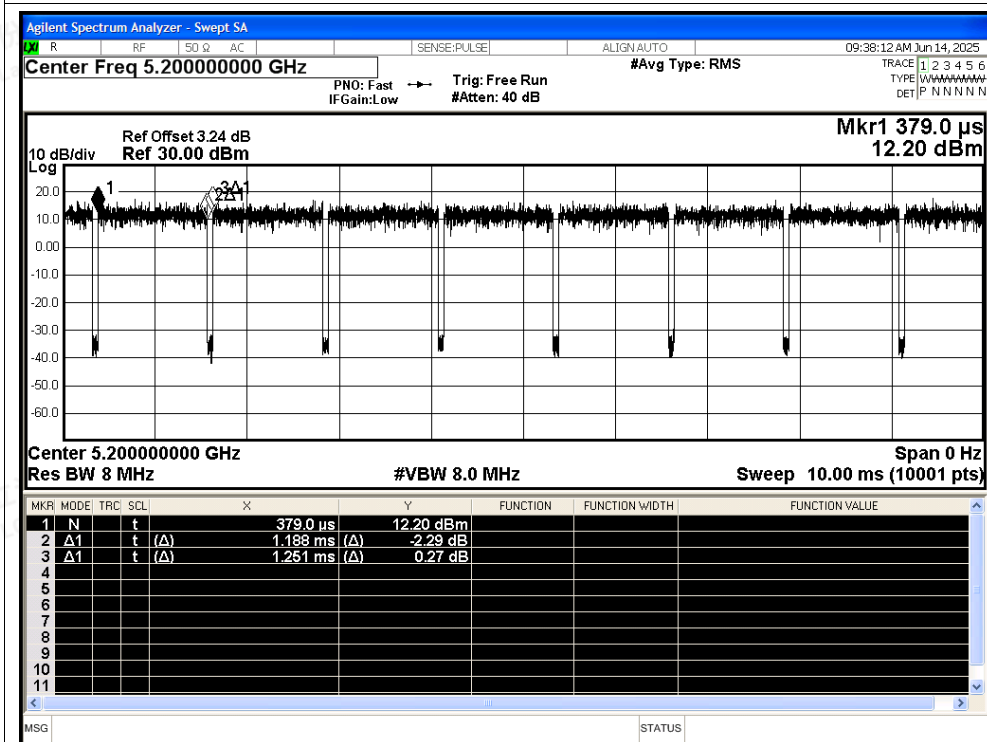

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5240MHz Ant2

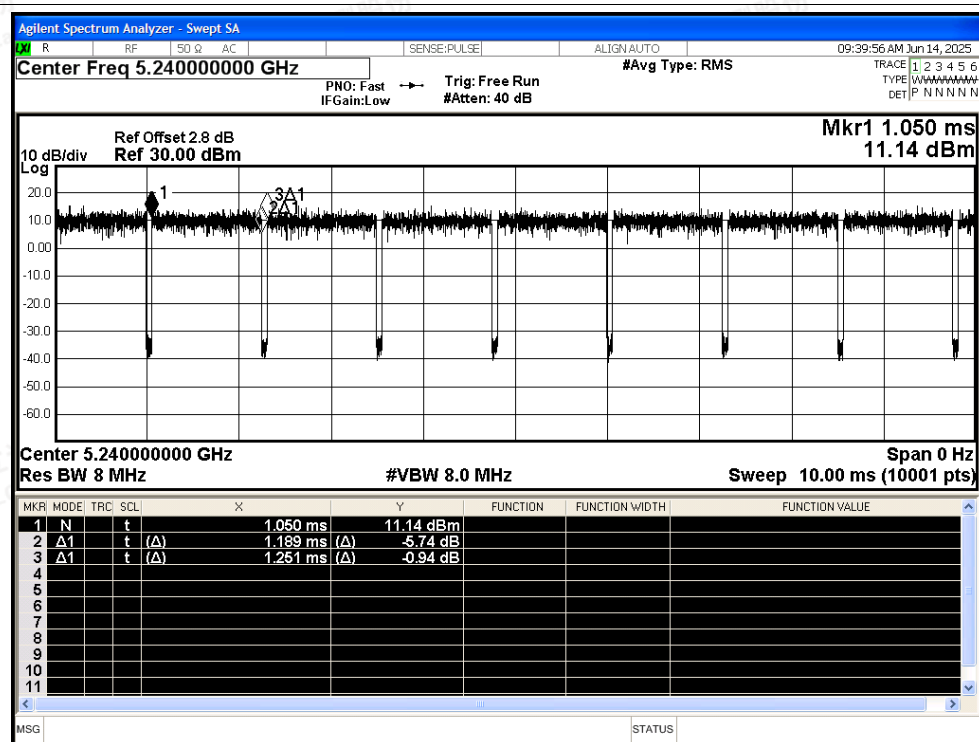

Duty Cycle NVNT ax40 5190MHz Ant2

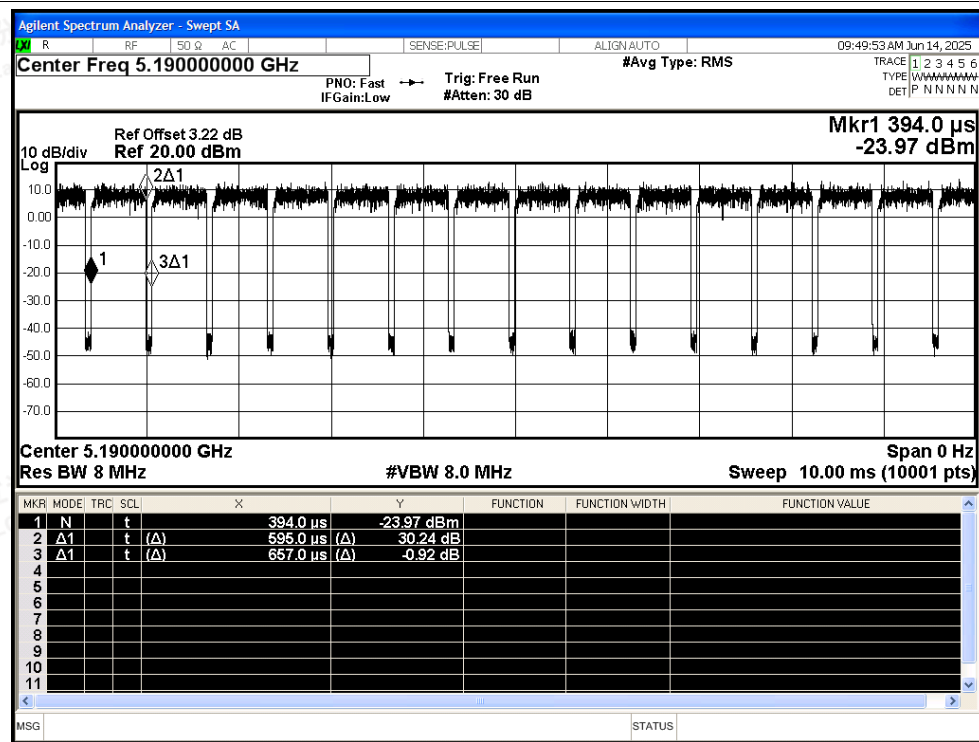

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5230MHz Ant2

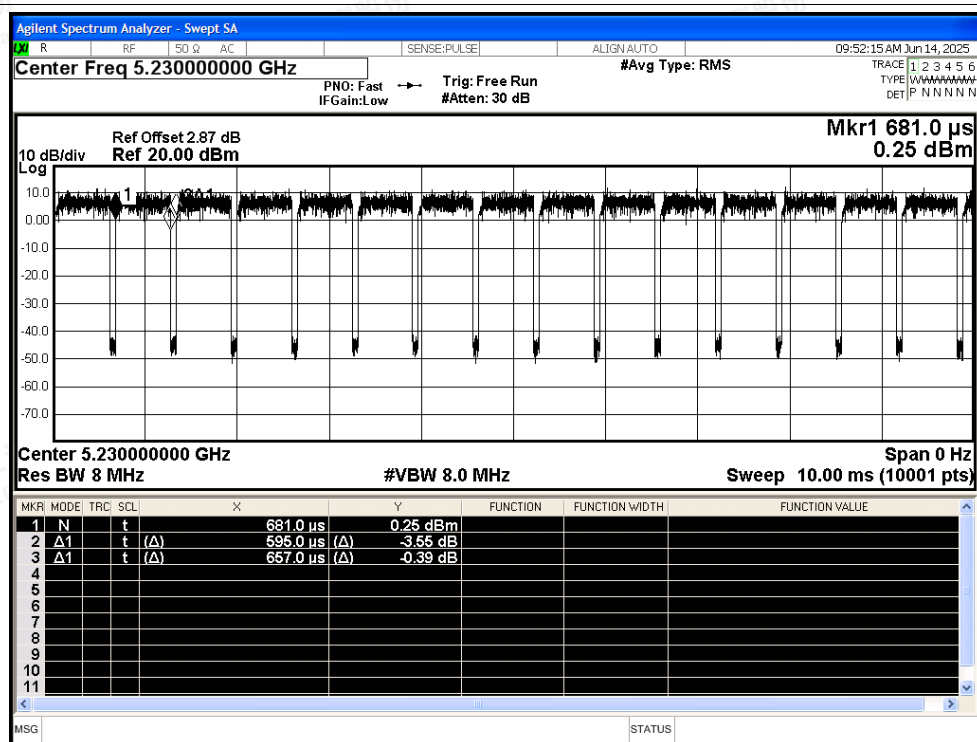

Duty Cycle NVNT ax80 5210MHz Ant2

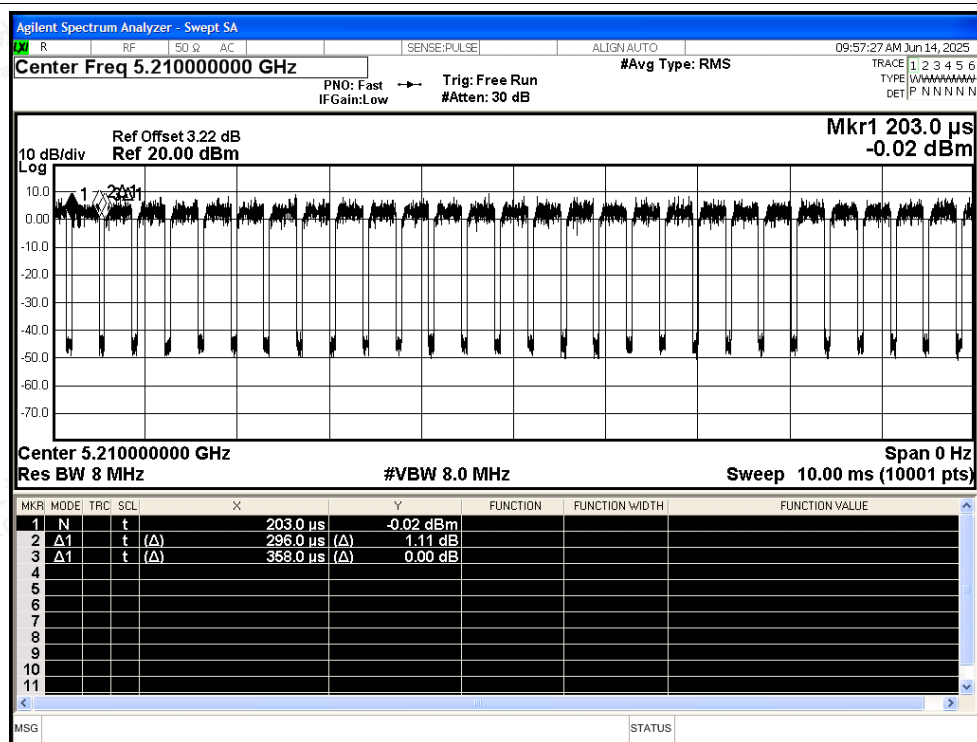

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity