





Tx. Spurious NVNT n20 2412MHz Ant3 Ref

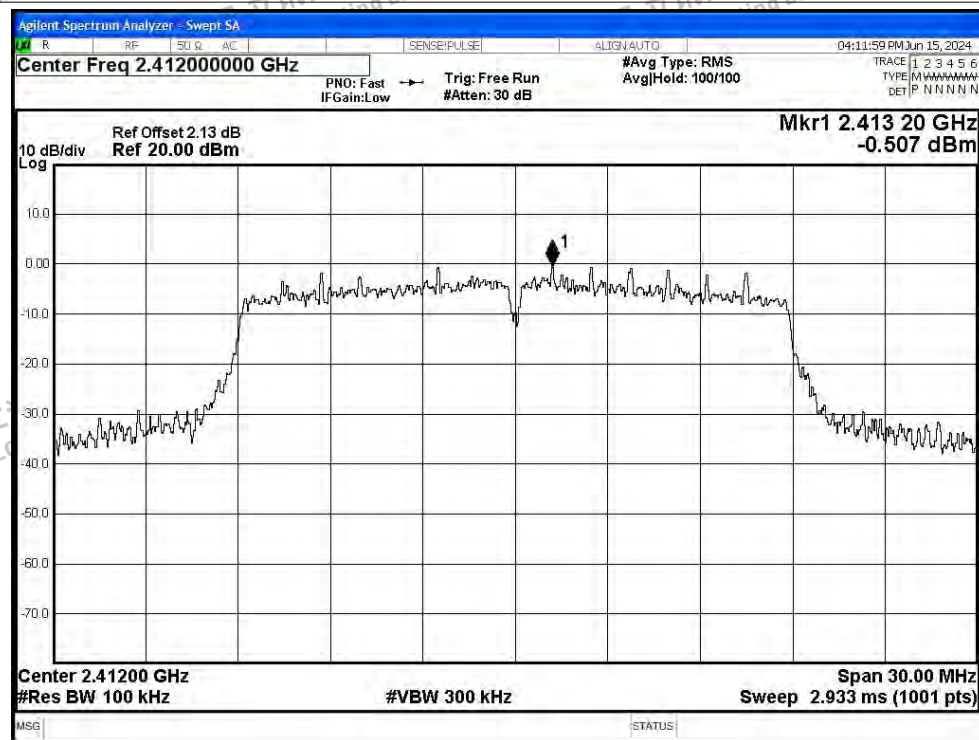


Tx. Spurious NVNT n20 2412MHz Ant3 Emission

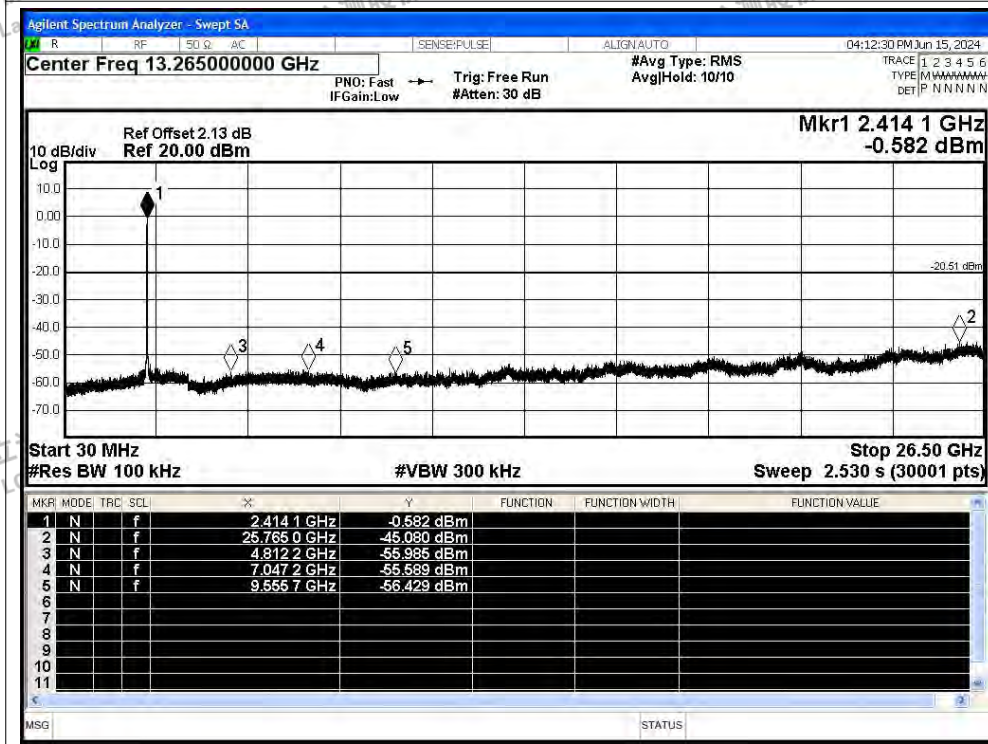




Tx. Spurious NVNT n20 2437MHz Ant3 Ref

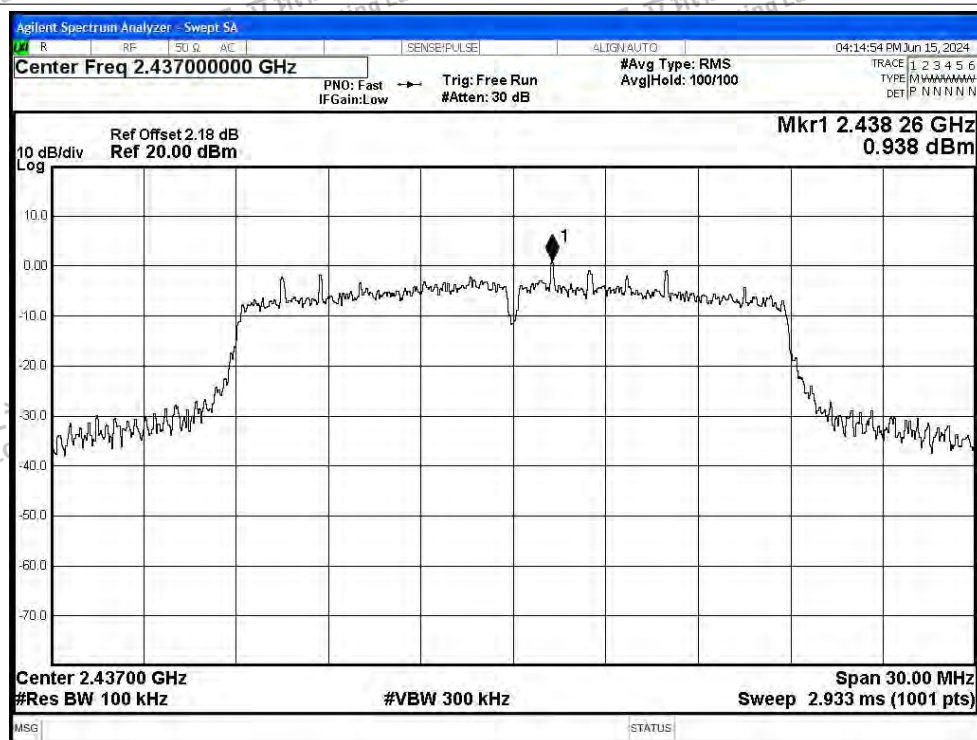

Tx. Spurious NVNT n20 2437MHz Ant3 Emission

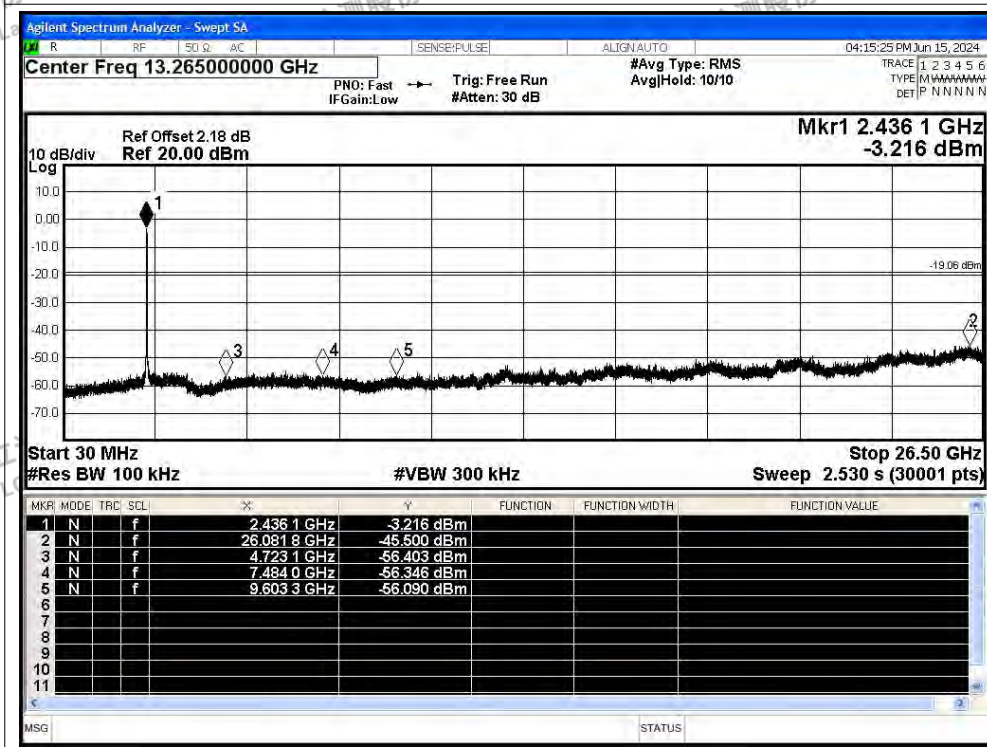

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT n20 2462MHz Ant3 Ref

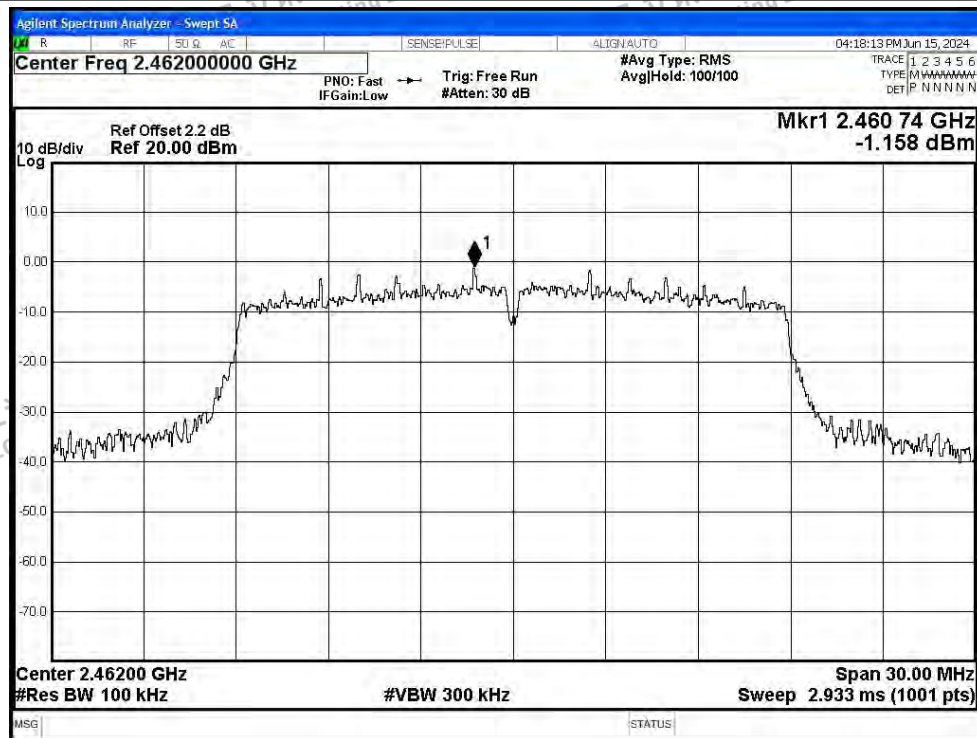


Tx. Spurious NVNT n20 2462MHz Ant3 Emission

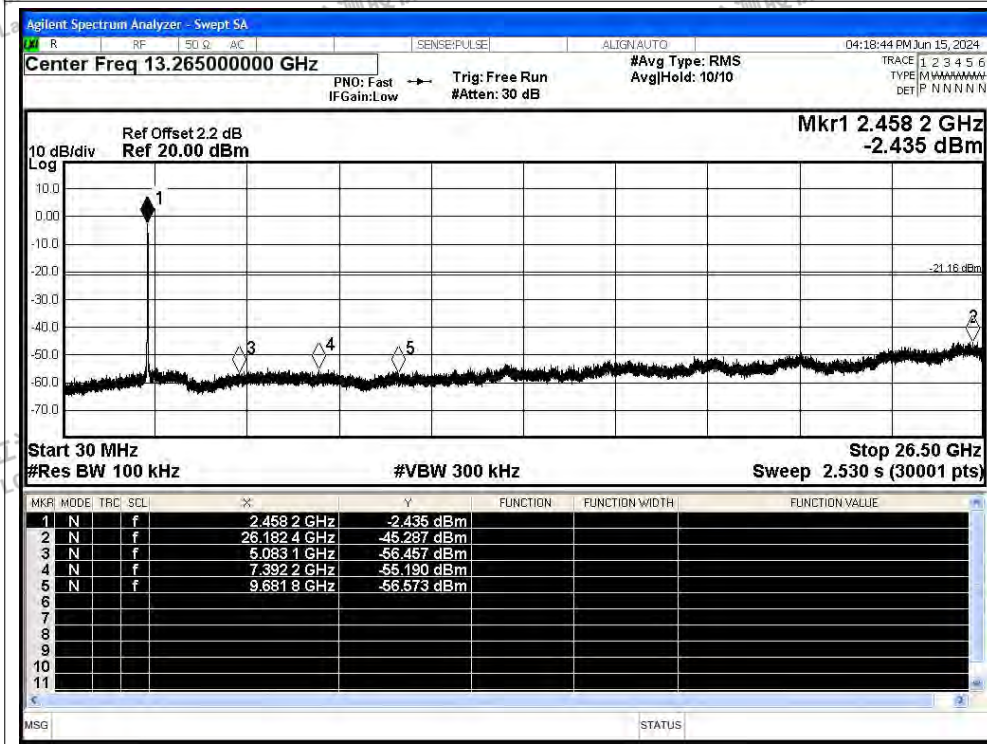




Tx. Spurious NVNT n40 2422MHz Ant3 Ref

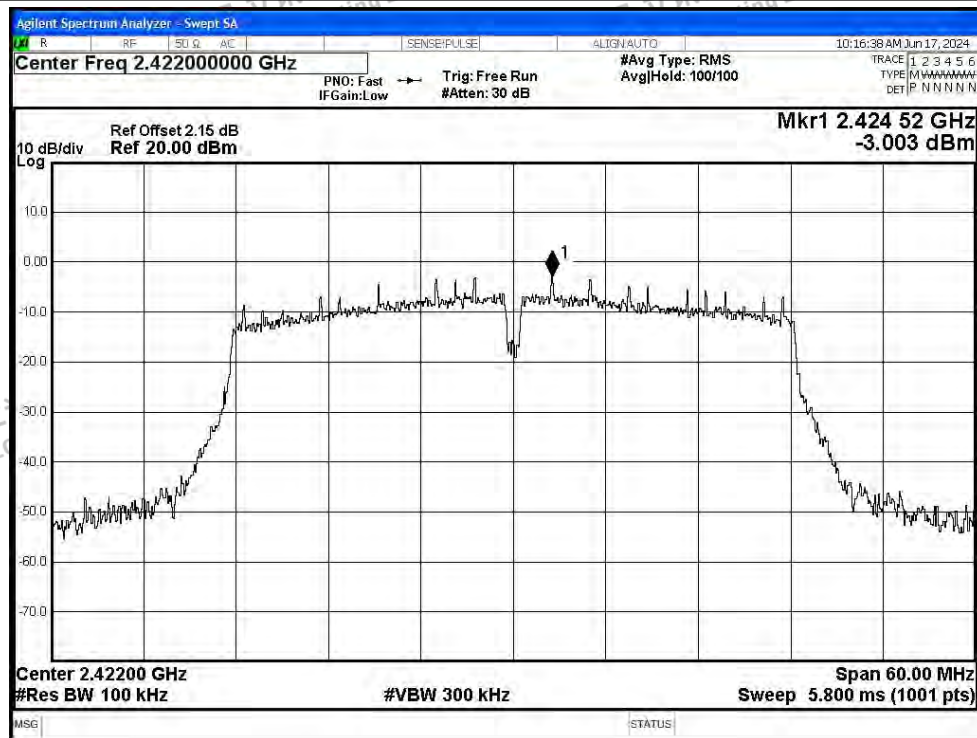


Tx. Spurious NVNT n40 2422MHz Ant3 Emission

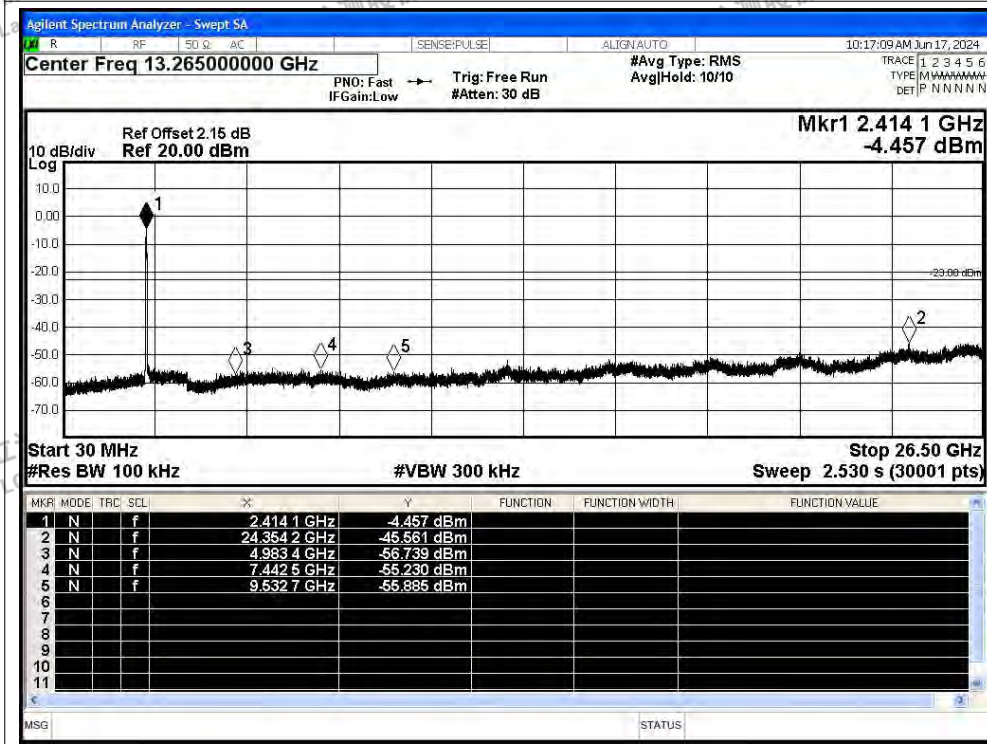




Tx. Spurious NVNT n40 2437MHz Ant3 Ref

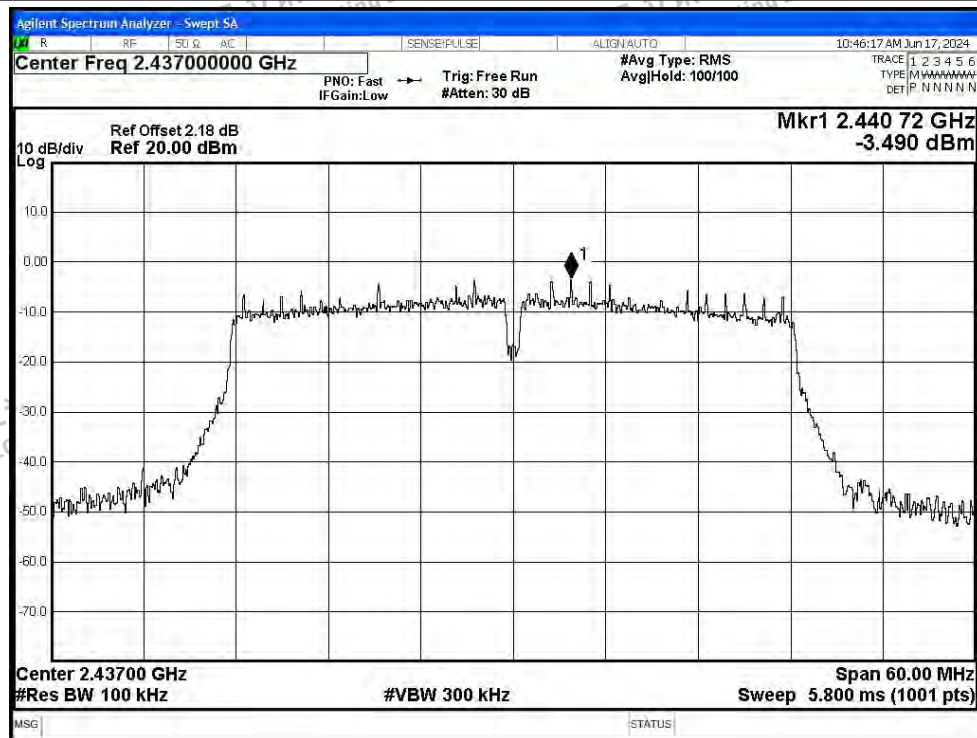


Tx. Spurious NVNT n40 2437MHz Ant3 Emission

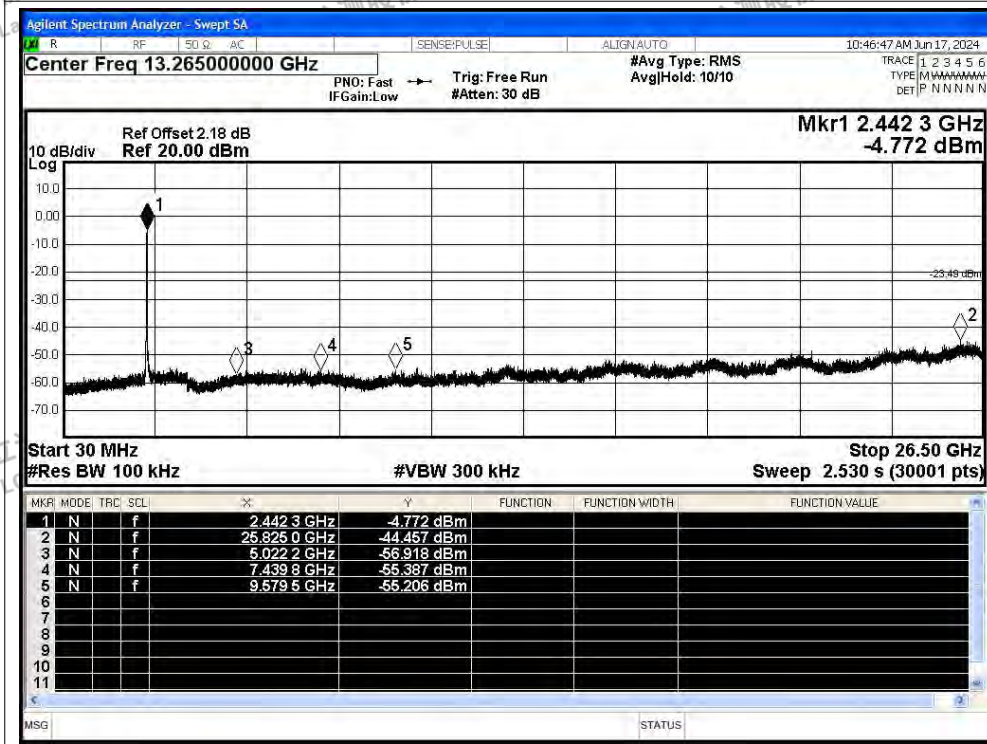




Tx. Spurious NVNT n40 2452MHz Ant3 Ref

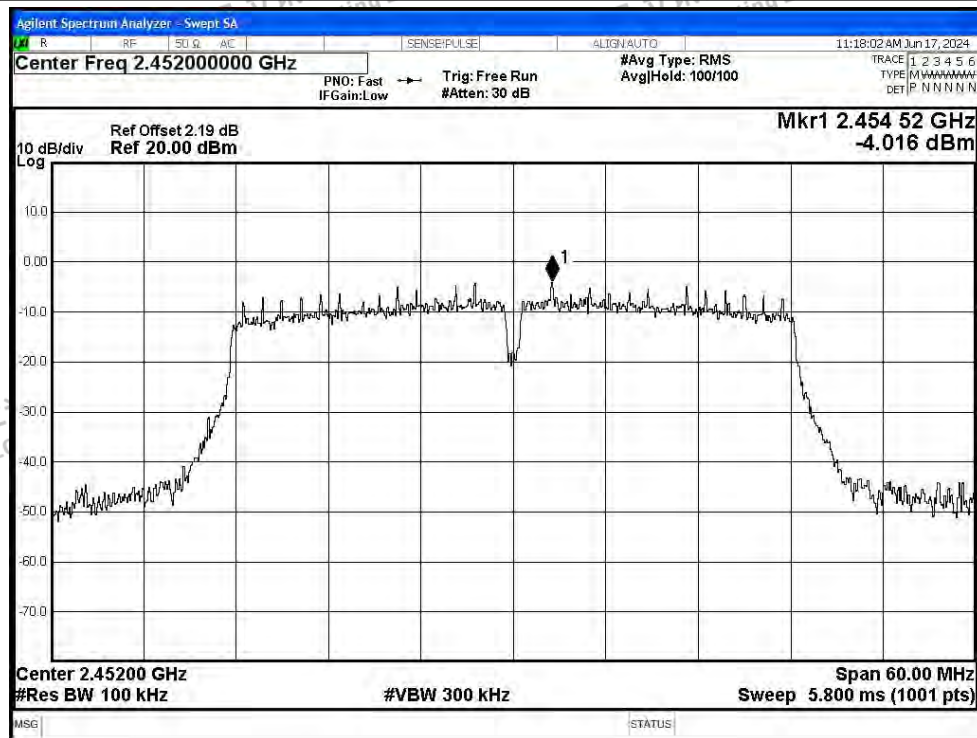


Tx. Spurious NVNT n40 2452MHz Ant3 Emission

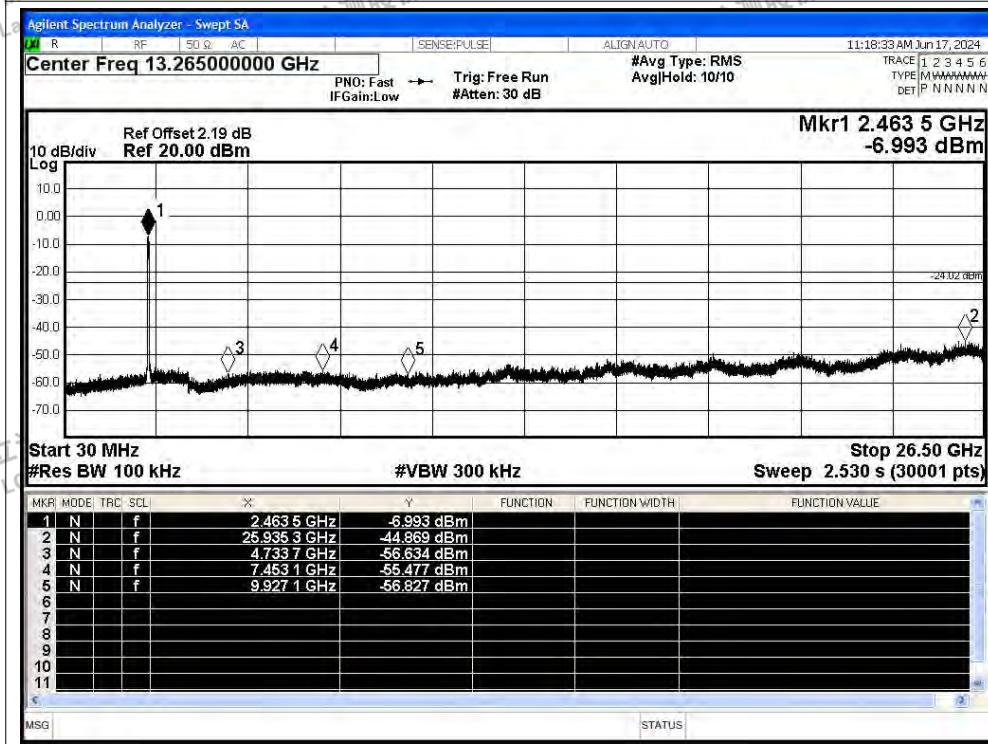




Tx. Spurious NVNT ax20 2412MHz Ant3 Ref

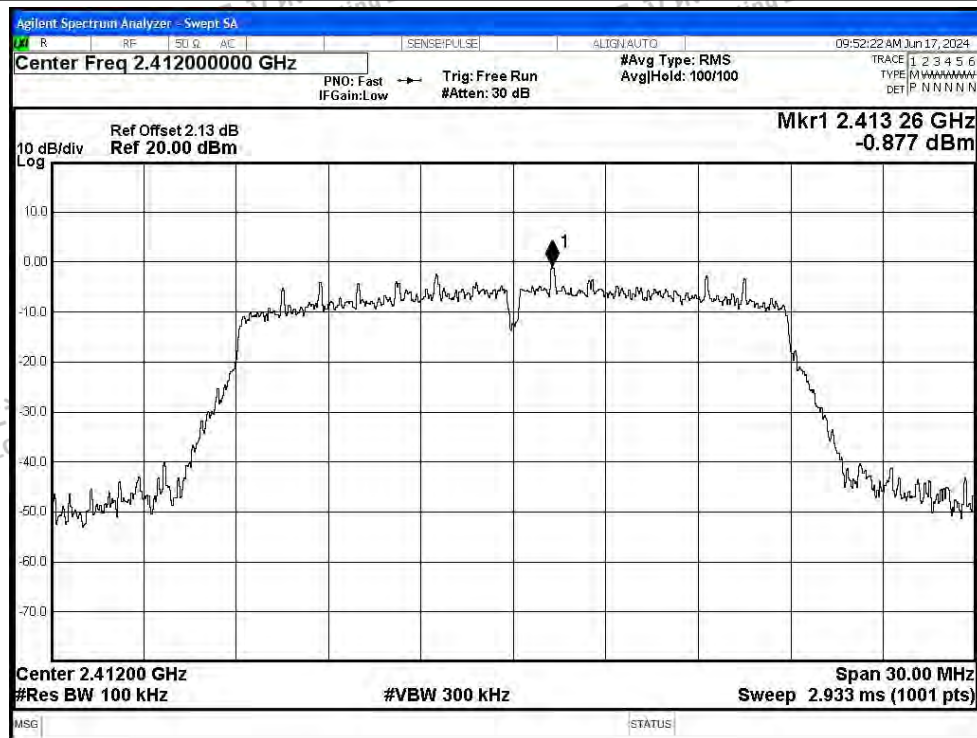


Tx. Spurious NVNT ax20 2412MHz Ant3 Emission

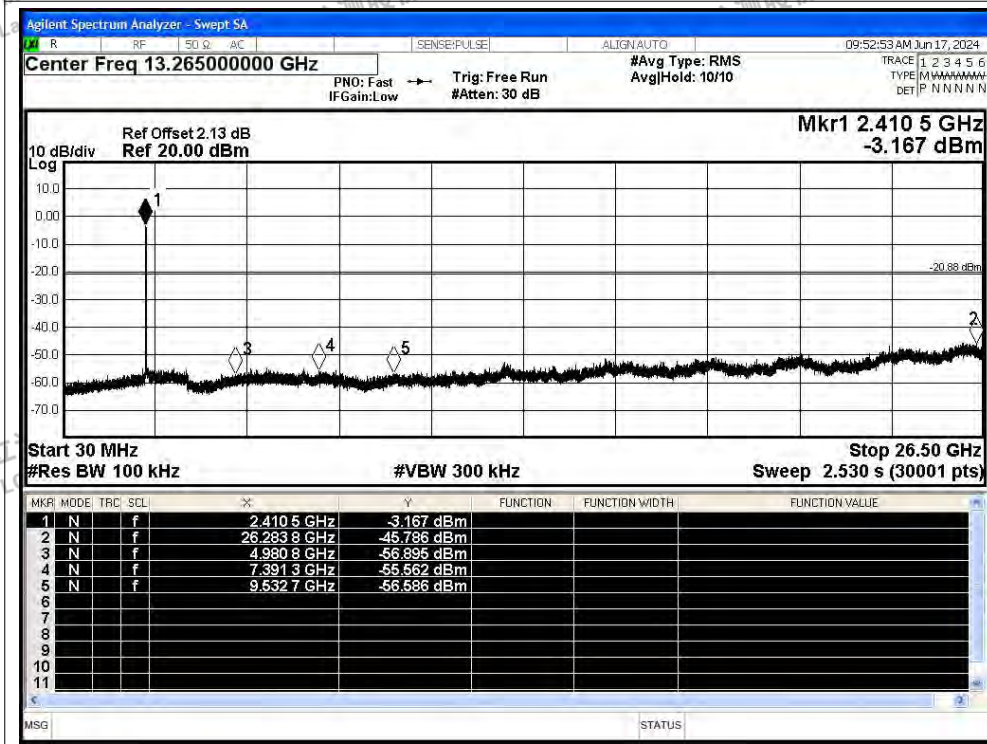




Tx. Spurious NVNT ax20 2437MHz Ant3 Ref

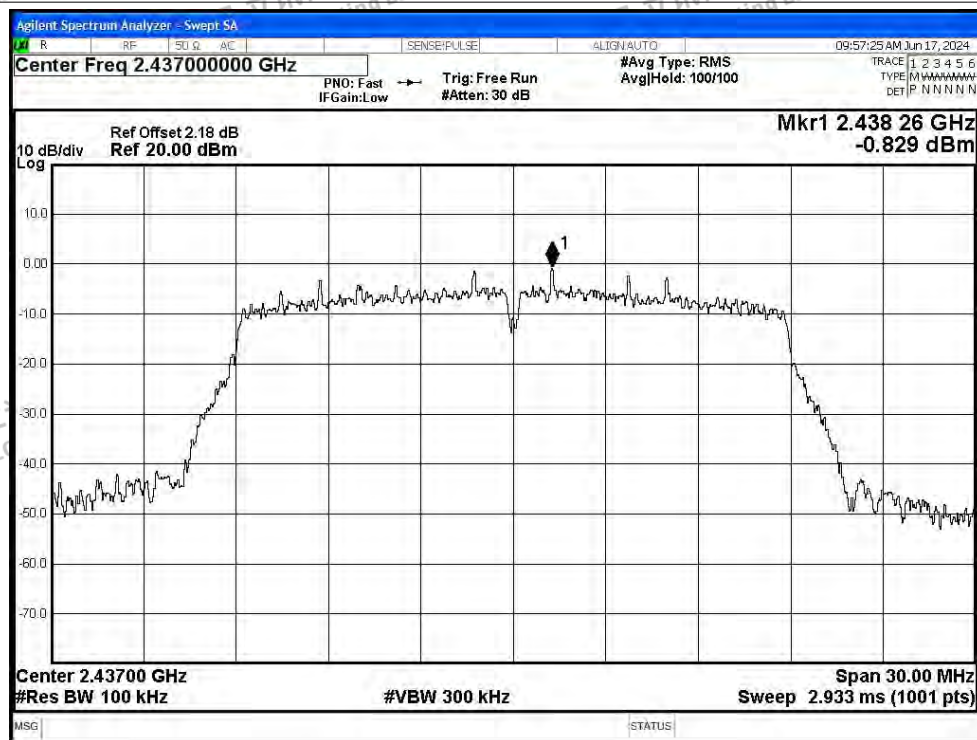


Tx. Spurious NVNT ax20 2437MHz Ant3 Emission

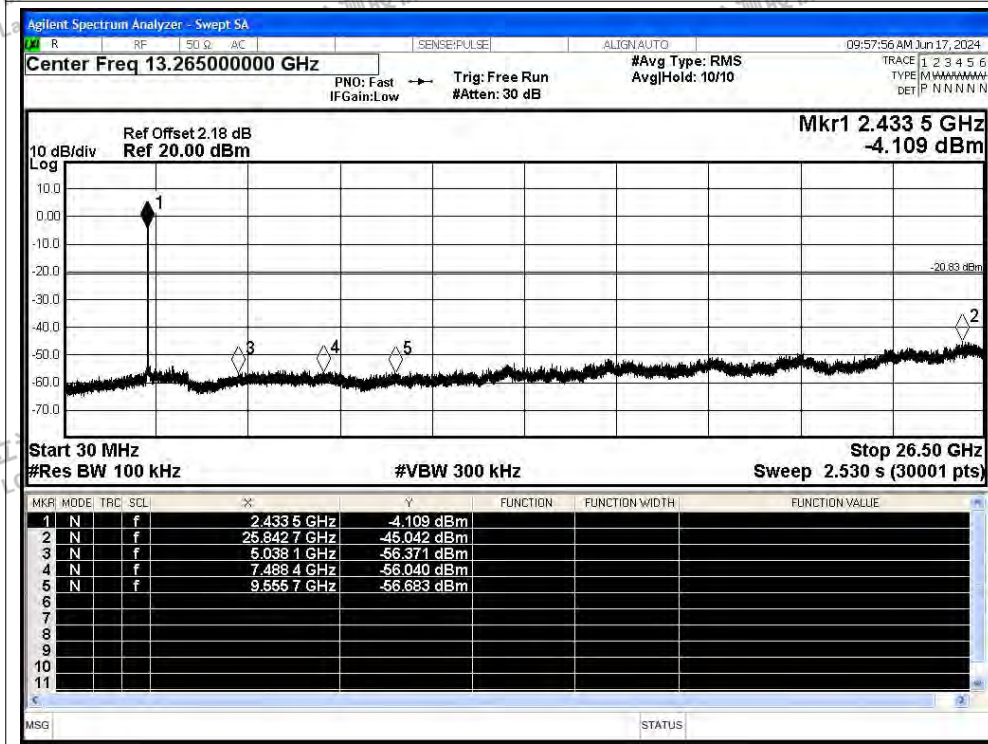




Tx: Spurious NVNT ax20 2462MHz Ant3 Ref

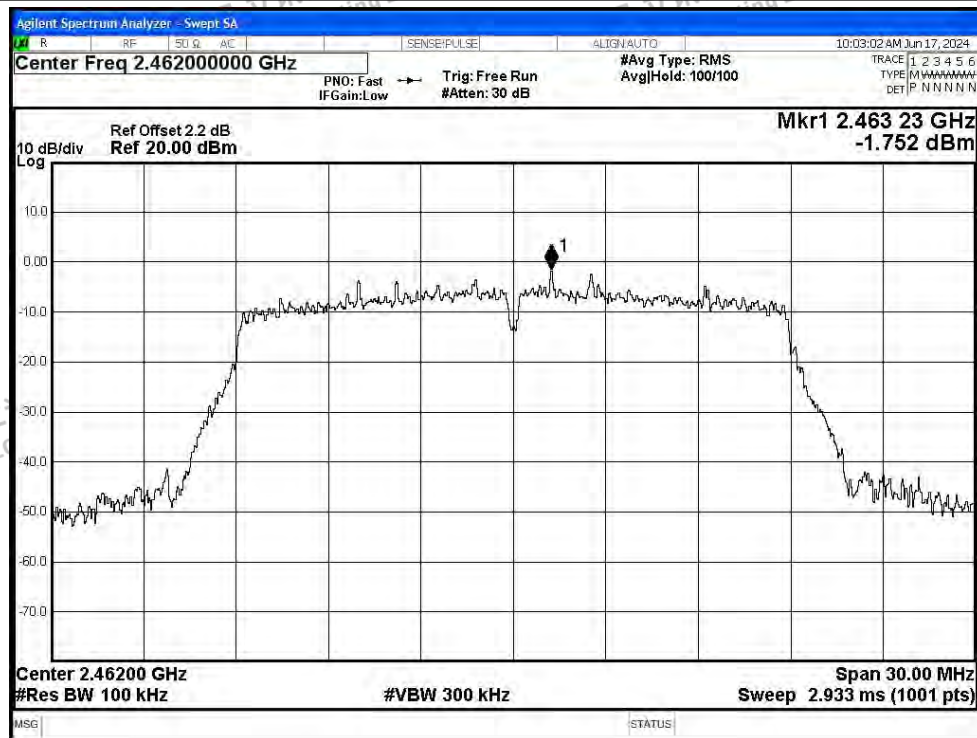


Tx: Spurious NVNT ax20 2462MHz Ant3 Emission

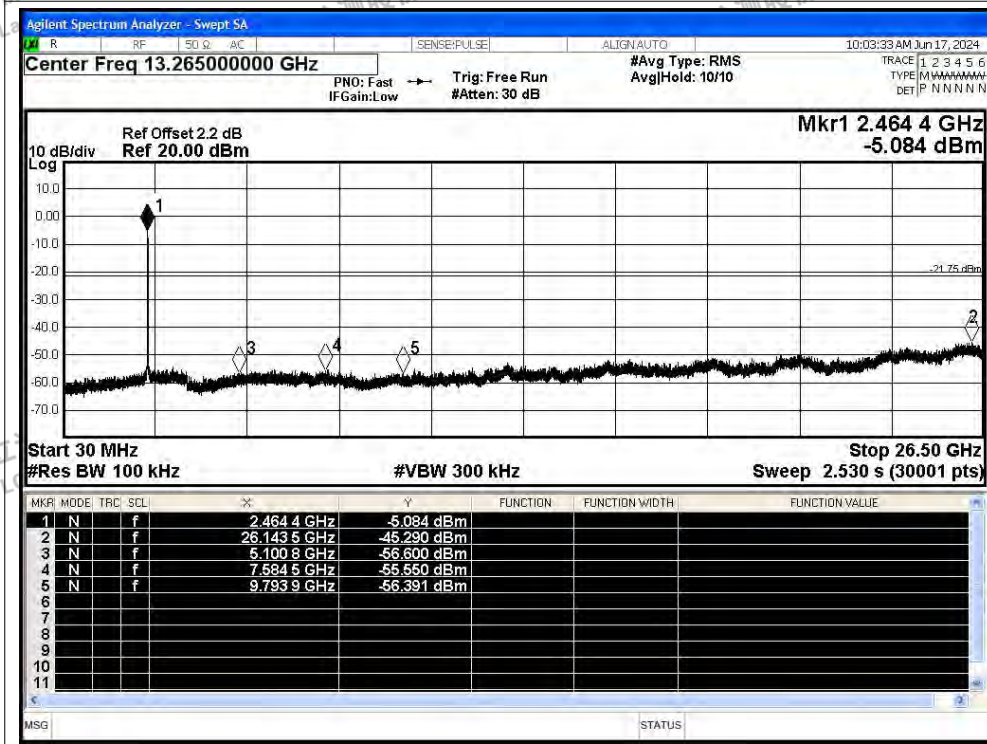




Tx. Spurious NVNT ax40 2422MHz Ant3 Ref

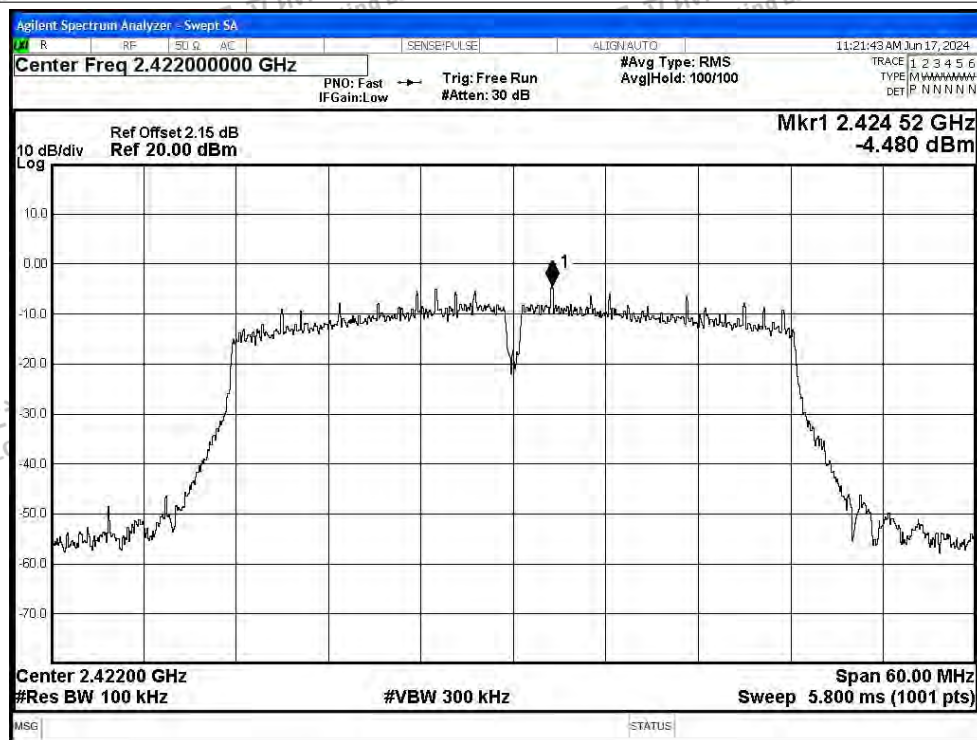


Tx. Spurious NVNT ax40 2422MHz Ant3 Emission

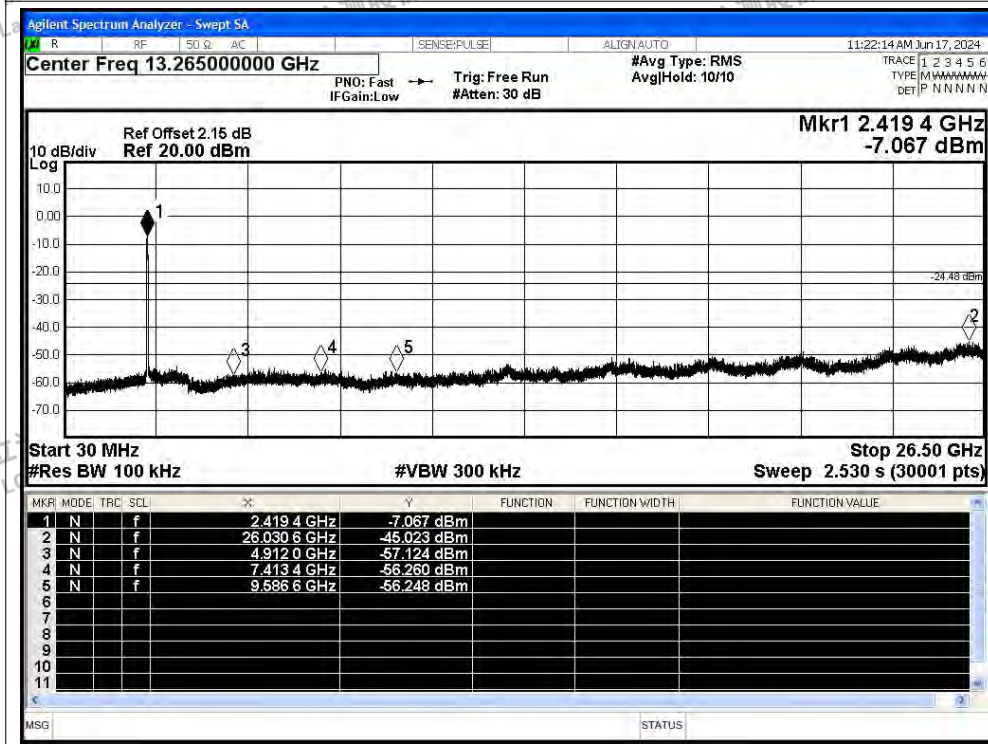




Tx: Spurious NVNT ax40 2437MHz Ant3 Ref

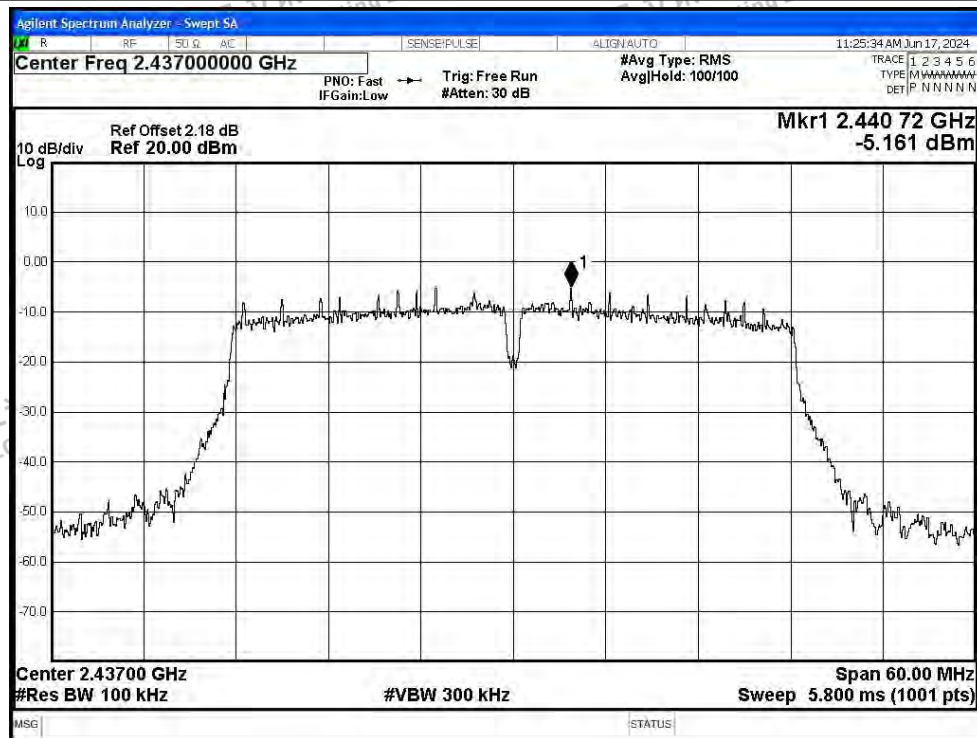


Tx: Spurious NVNT ax40 2437MHz Ant3 Emission

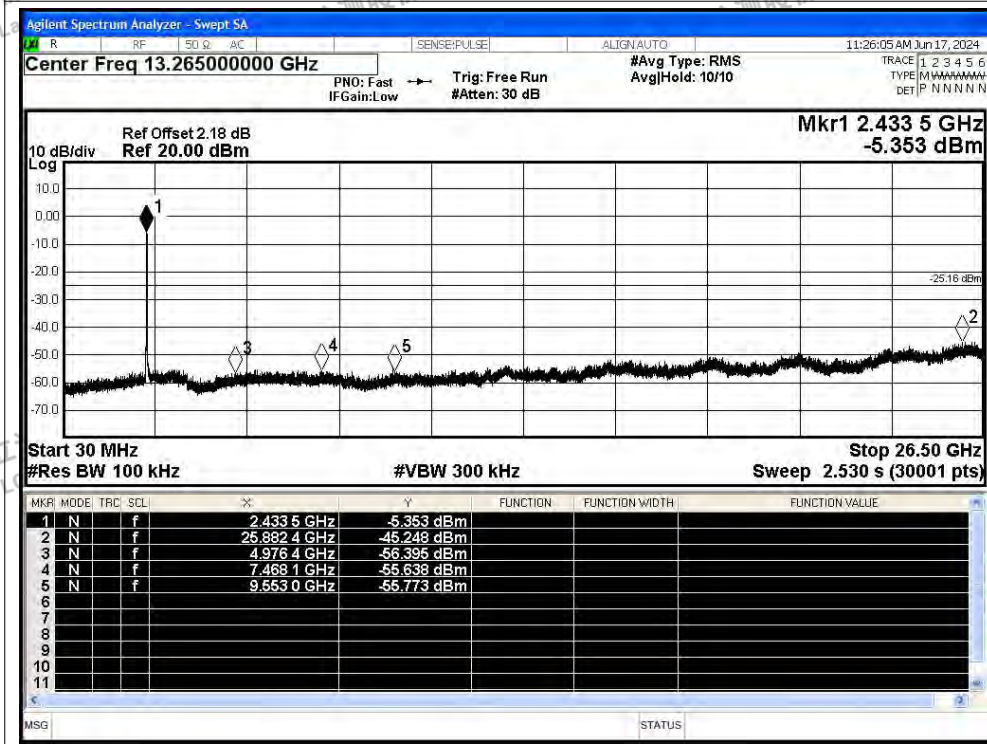




Tx: Spurious NVNT ax40 2452MHz Ant3 Ref

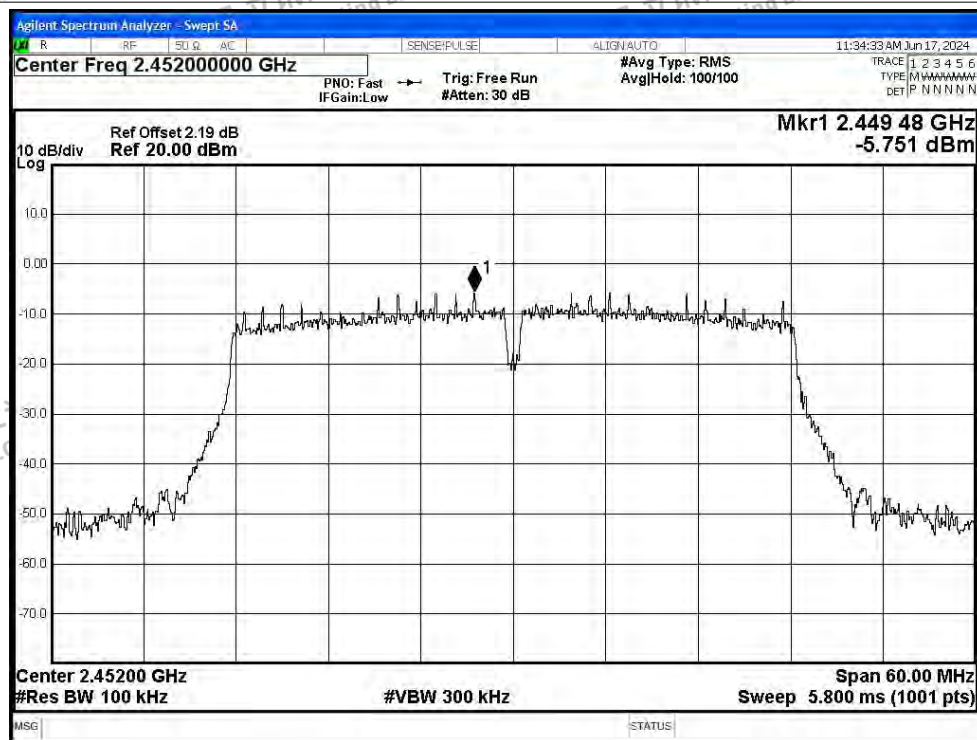

Tx: Spurious NVNT ax40 2452MHz Ant3 Emission

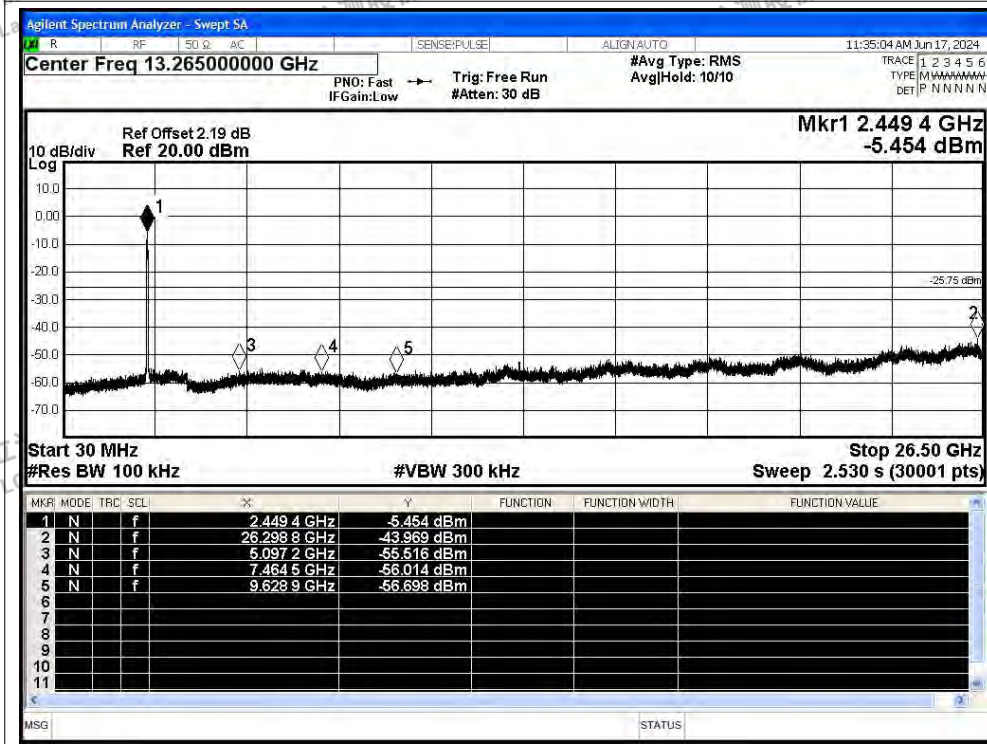



Condition	Mode	Frequency (MHz)	Antenna	Max Value (dBc)	Limit (dBc)	Verdict
NVNT	b	2412	Ant4	-51.01	-20	Pass
NVNT	b	2437	Ant4	-49.85	-20	Pass
NVNT	b	2462	Ant4	-49.41	-20	Pass
NVNT	g	2412	Ant4	-45.31	-20	Pass
NVNT	g	2437	Ant4	-45.99	-20	Pass
NVNT	g	2462	Ant4	-45.08	-20	Pass
NVNT	n20	2412	Ant4	-45.59	-20	Pass
NVNT	n20	2437	Ant4	-44.4	-20	Pass
NVNT	n20	2462	Ant4	-41.41	-20	Pass
NVNT	n40	2422	Ant4	-41.06	-20	Pass
NVNT	n40	2437	Ant4	-39.29	-20	Pass
NVNT	n40	2452	Ant4	-39.89	-20	Pass
NVNT	ax20	2412	Ant4	-42.28	-20	Pass
NVNT	ax20	2437	Ant4	-43.02	-20	Pass
NVNT	ax20	2462	Ant4	-42.06	-20	Pass
NVNT	ax40	2422	Ant4	-39.55	-20	Pass
NVNT	ax40	2437	Ant4	-38.52	-20	Pass
NVNT	ax40	2452	Ant4	-37.46	-20	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Tx: Spurious NVNT b 2412MHz Ant4 Ref

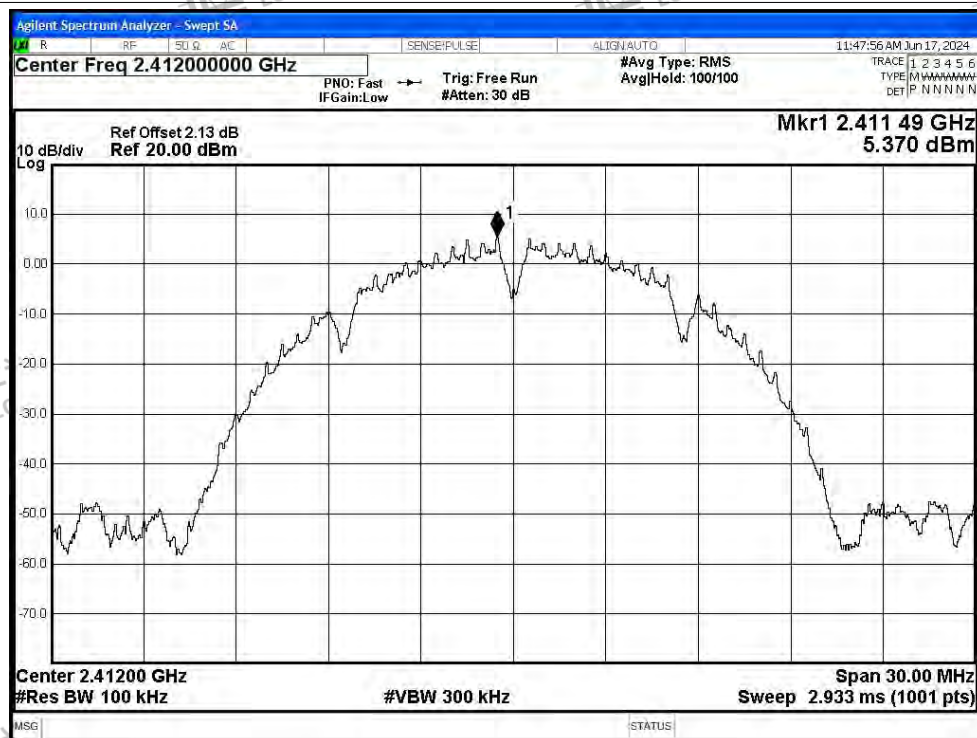

Tx: Spurious NVNT b 2412MHz Ant4 Emission

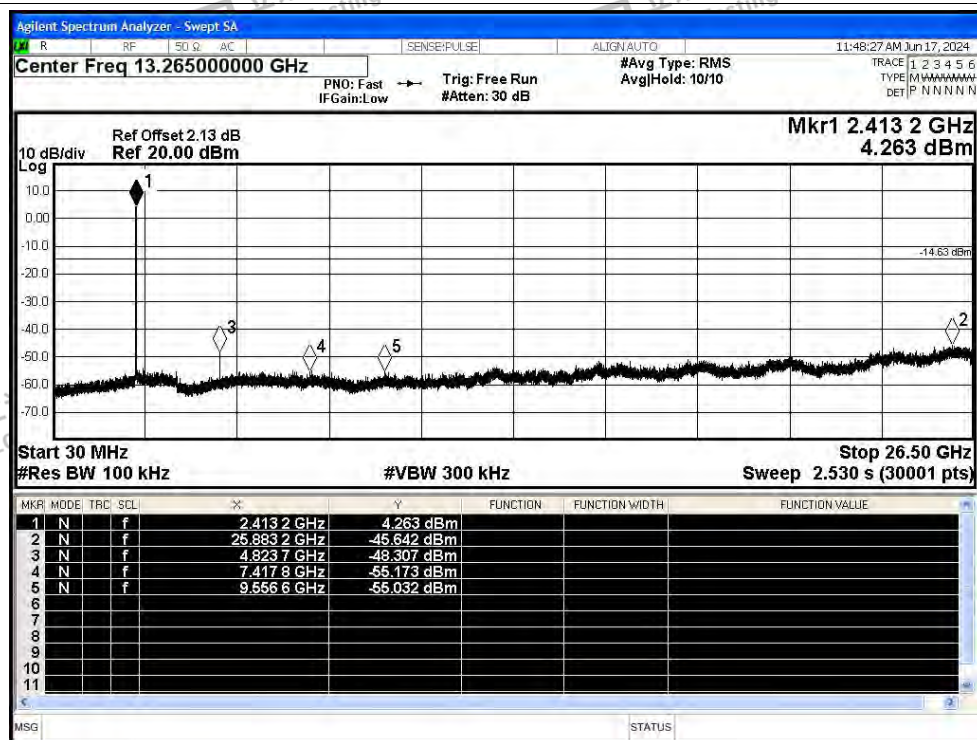

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx: Spurious NVNT b 2437MHz Ant4 Ref

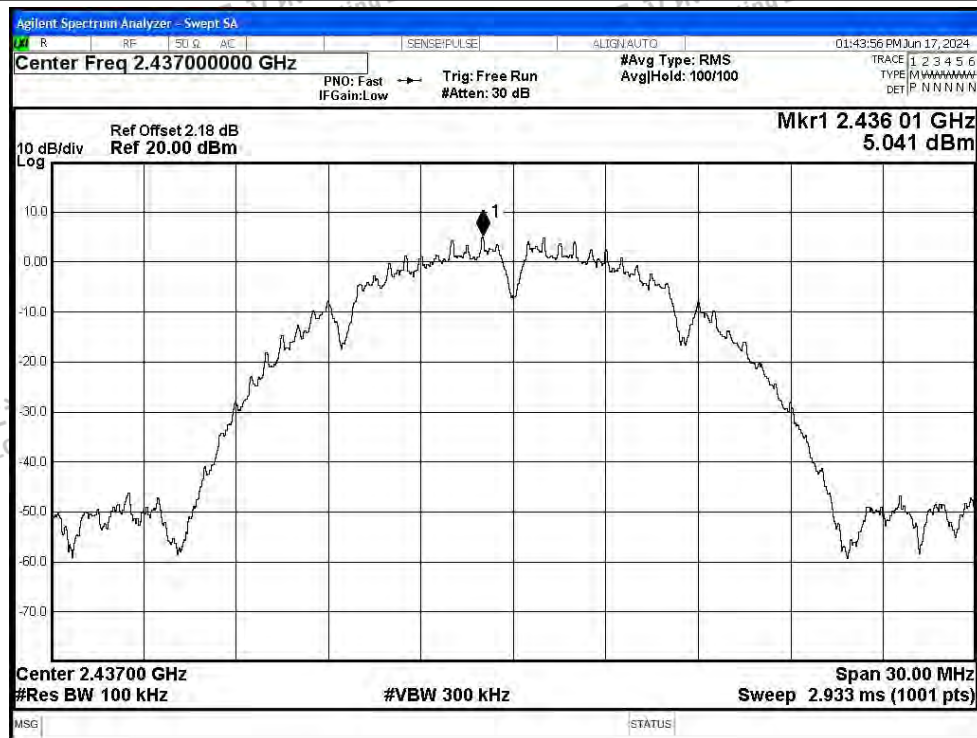


Tx: Spurious NVNT b 2437MHz Ant4 Emission

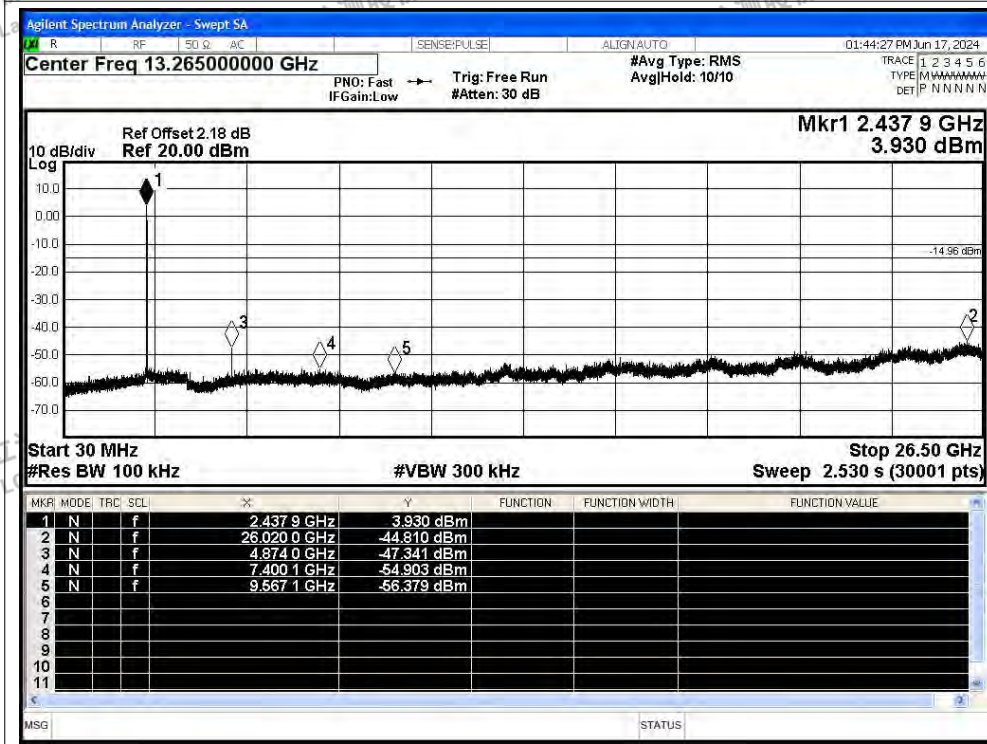




Tx: Spurious NVNT b 2462MHz Ant4 Ref

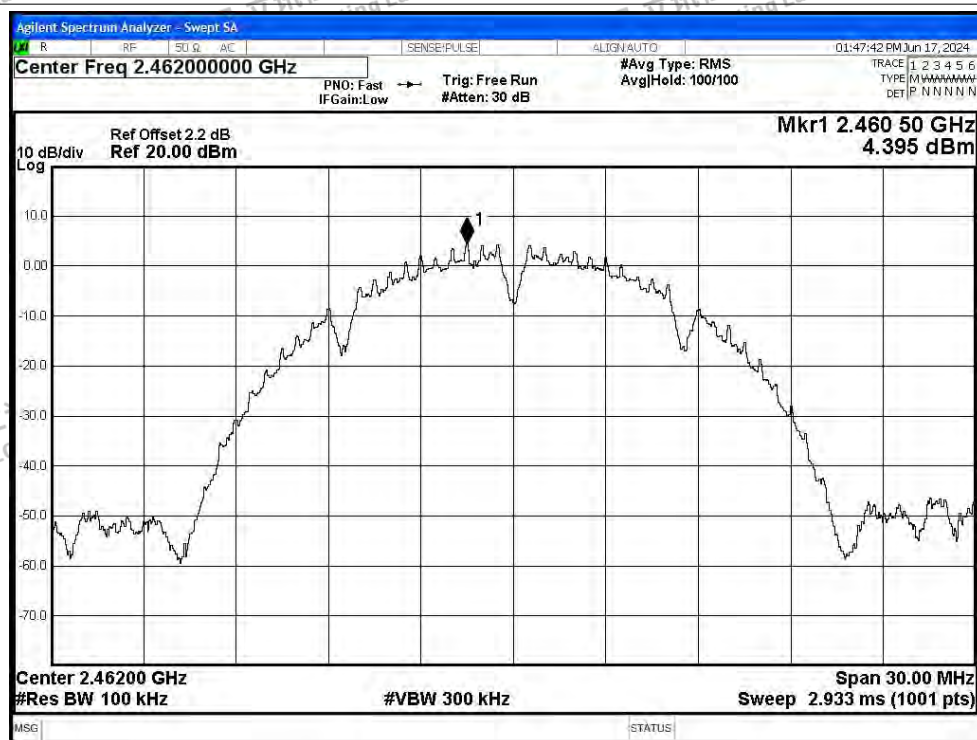


Tx: Spurious NVNT b 2462MHz Ant4 Emission

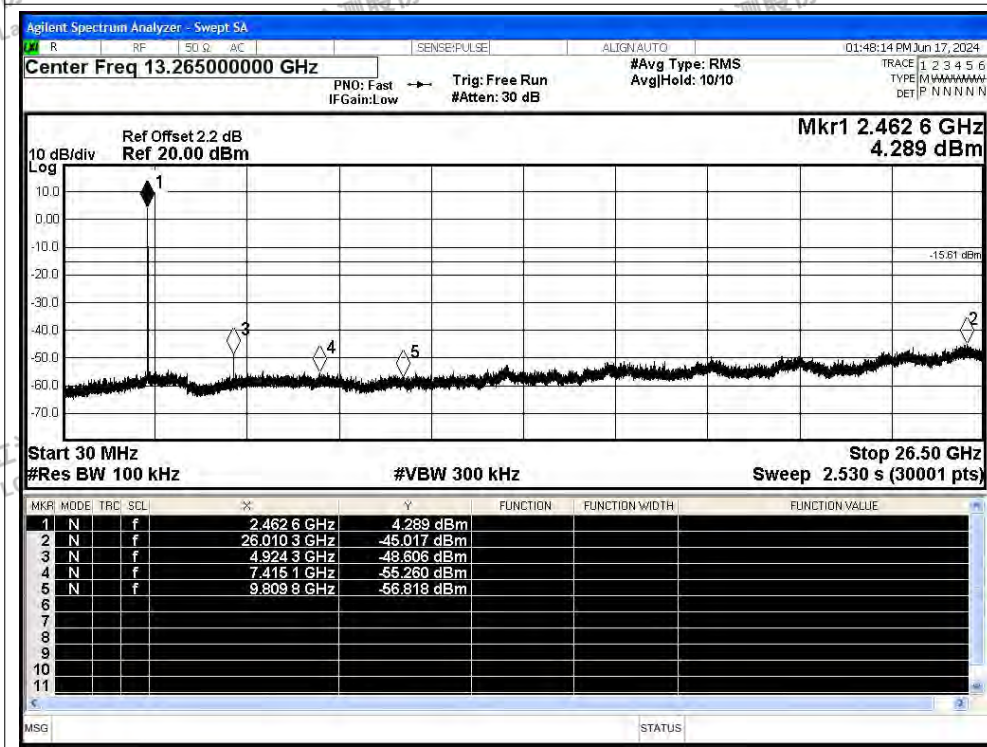




Tx: Spurious NVNT g 2412MHz Ant4 Ref

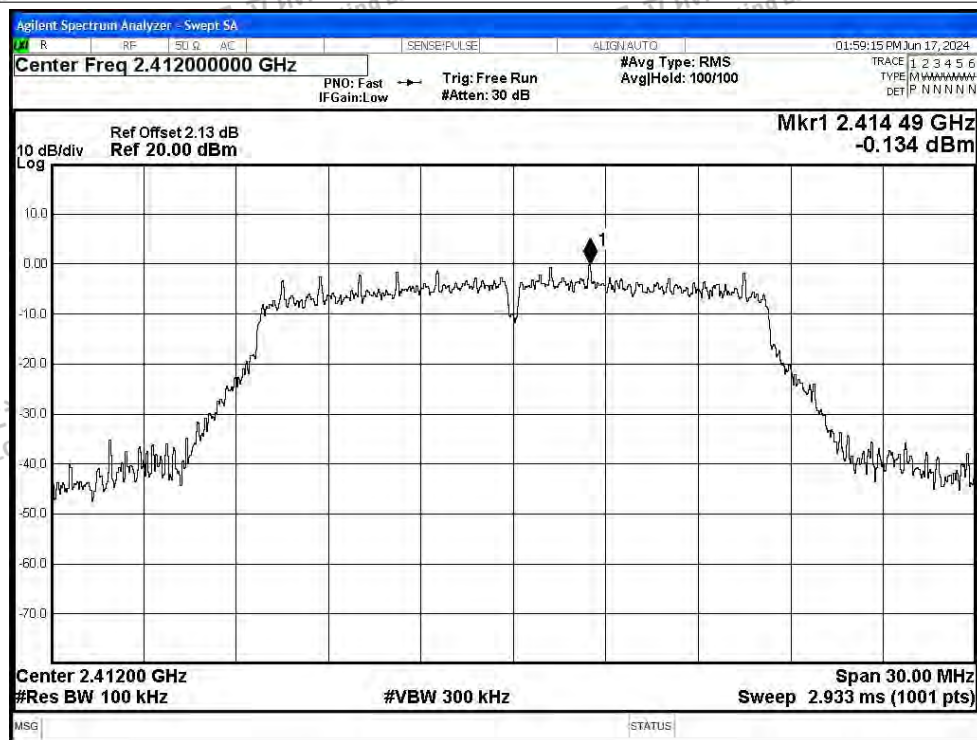


Tx: Spurious NVNT g 2412MHz Ant4 Emission

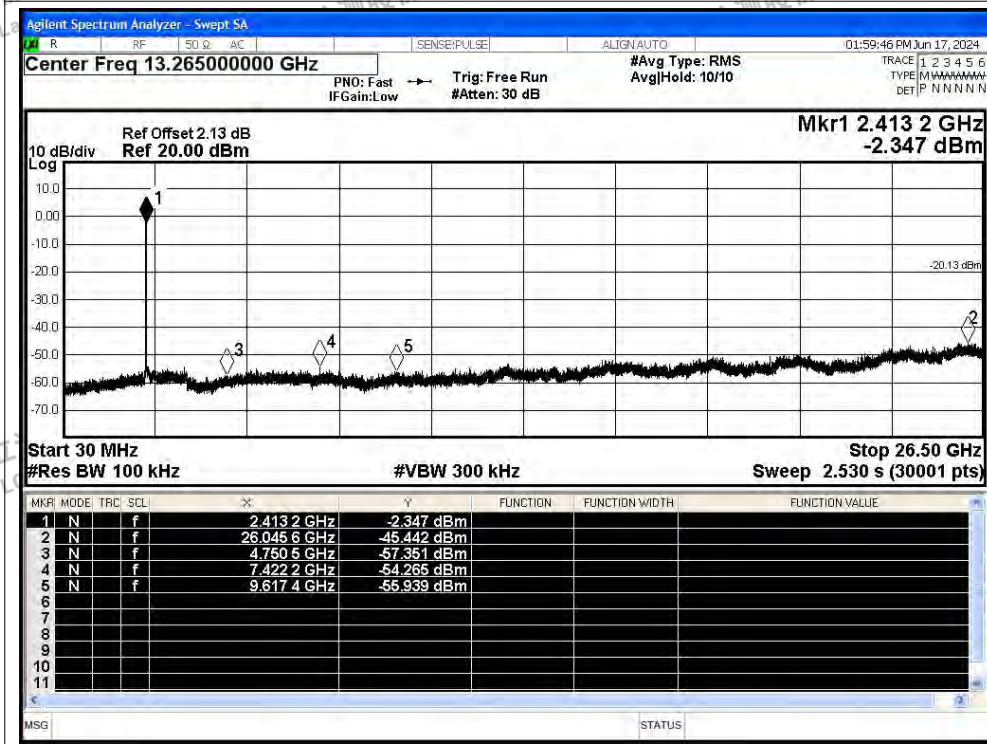




Tx: Spurious NVNT g 2437MHz Ant4 Ref

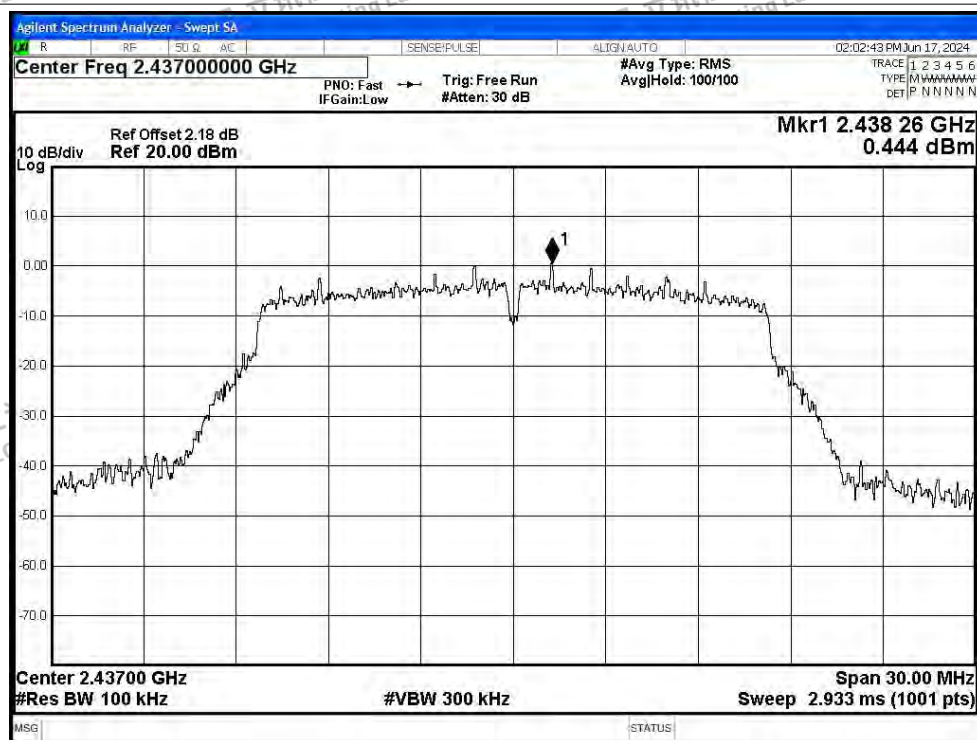

Tx: Spurious NVNT g 2437MHz Ant4 Emission

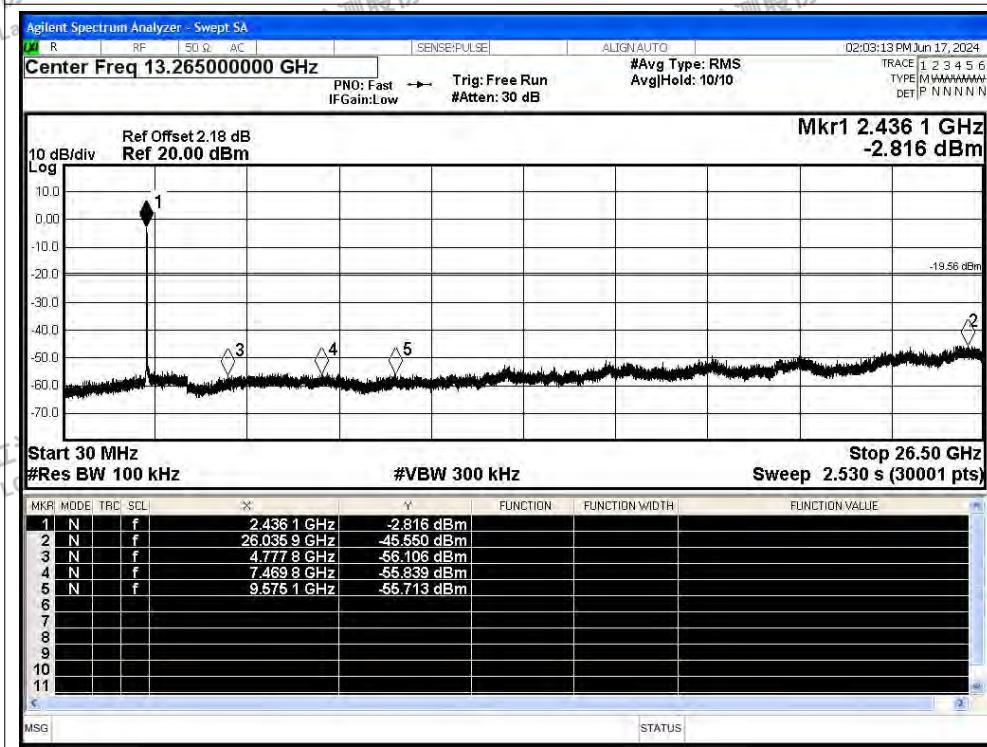

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx: Spurious NVNT g 2462MHz Ant4 Ref

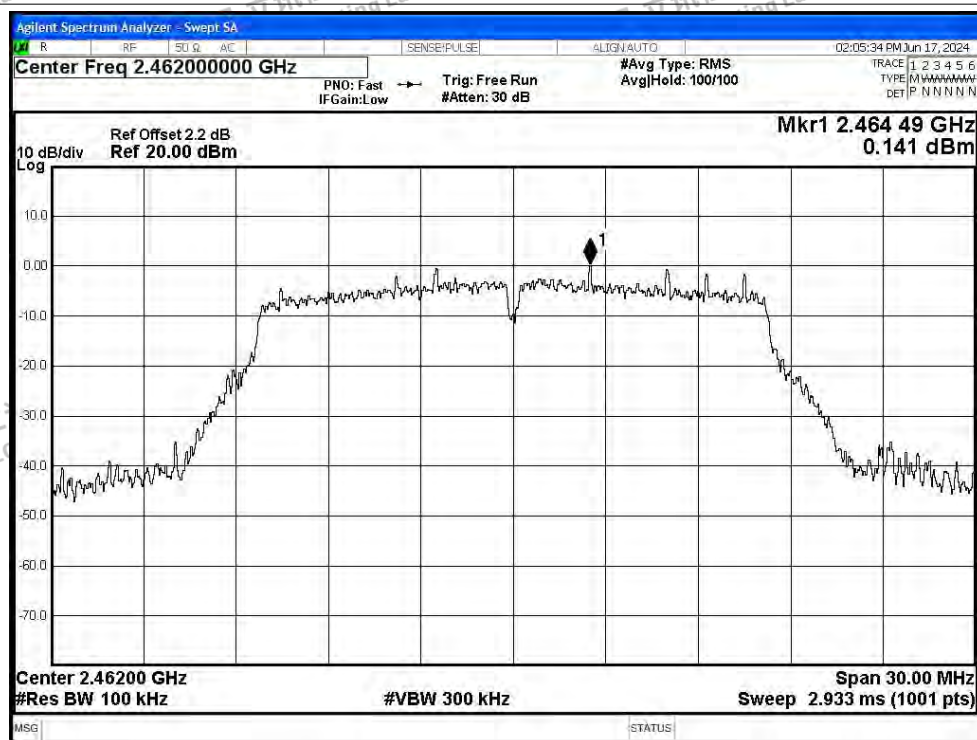

Tx: Spurious NVNT g 2462MHz Ant4 Emission

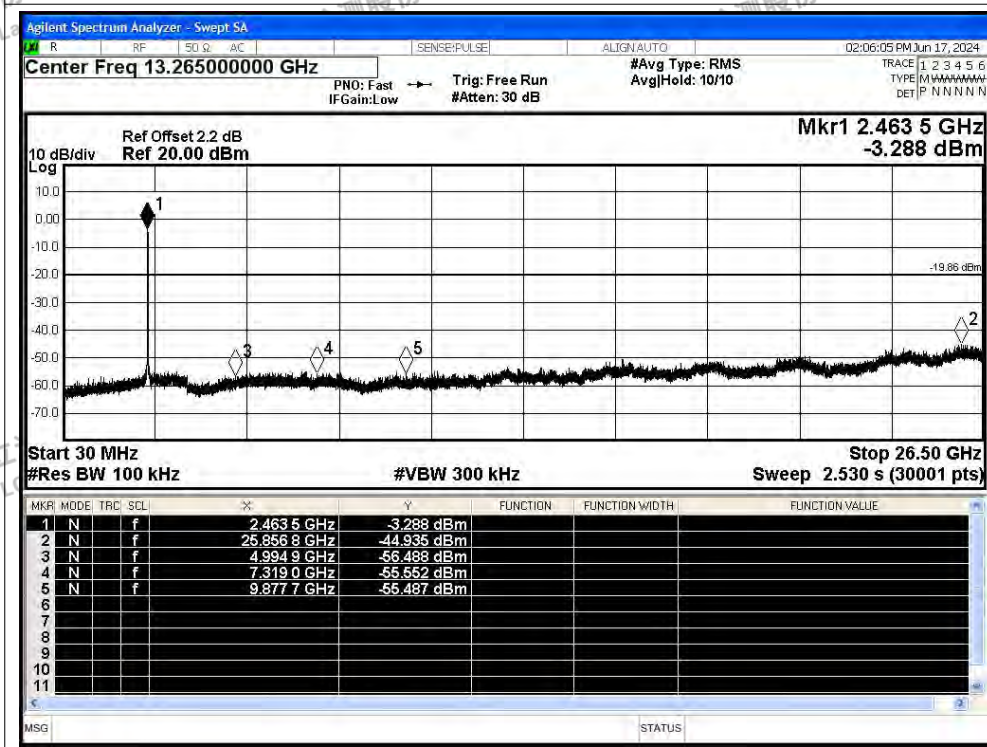

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT n20 2412MHz Ant4 Ref

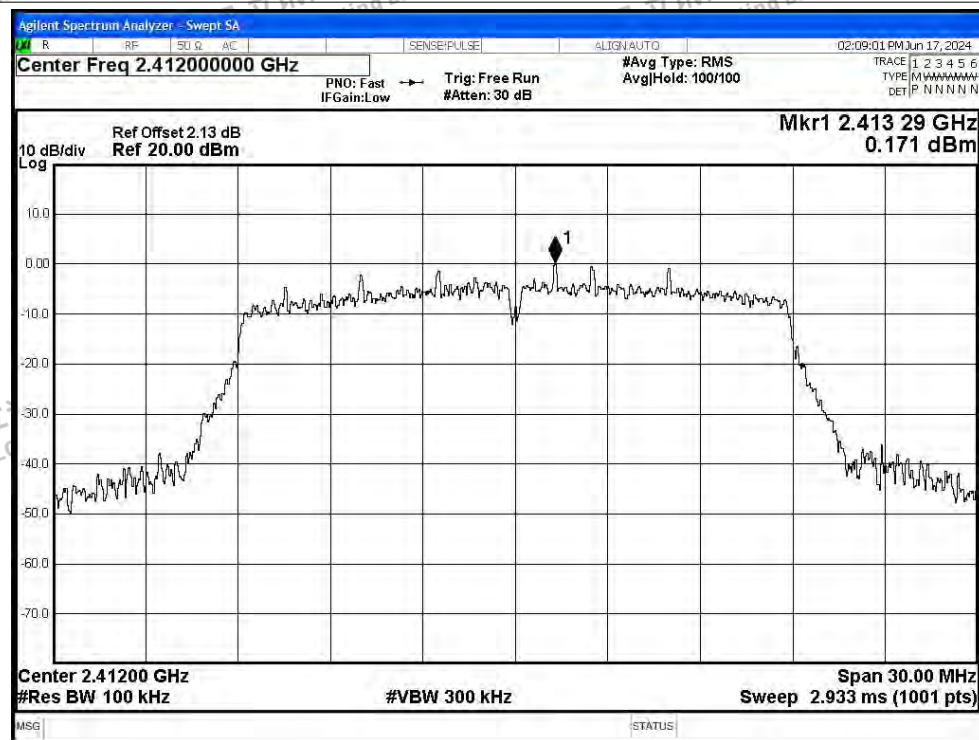


Tx. Spurious NVNT n20 2412MHz Ant4 Emission

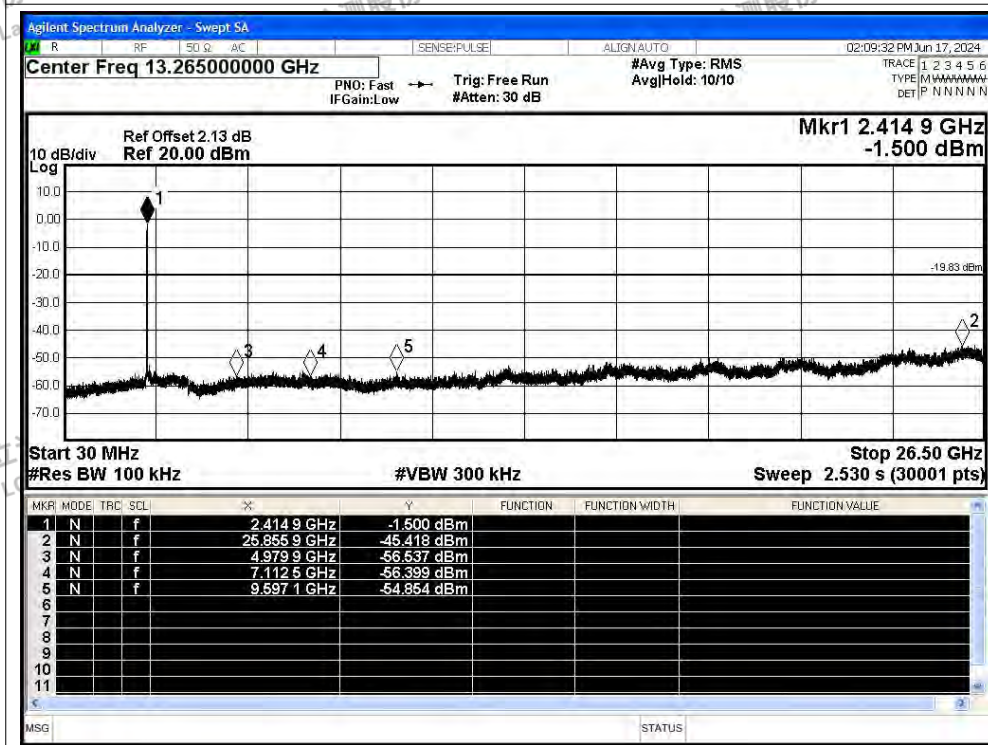




Tx. Spurious NVNT n20 2437MHz Ant4 Ref

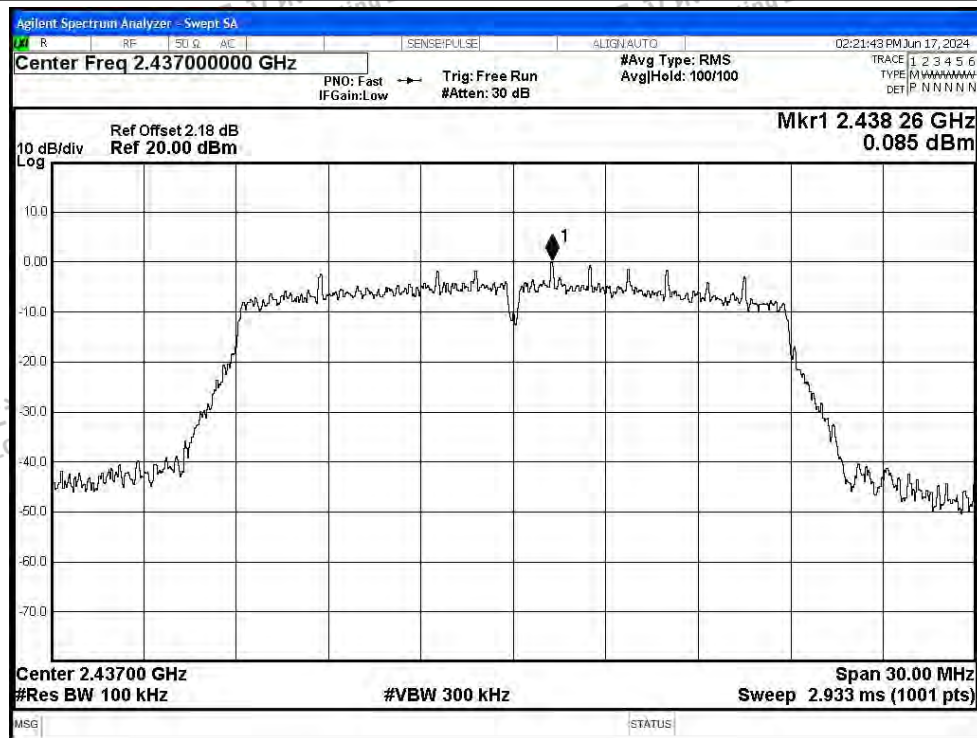


Tx. Spurious NVNT n20 2437MHz Ant4 Emission

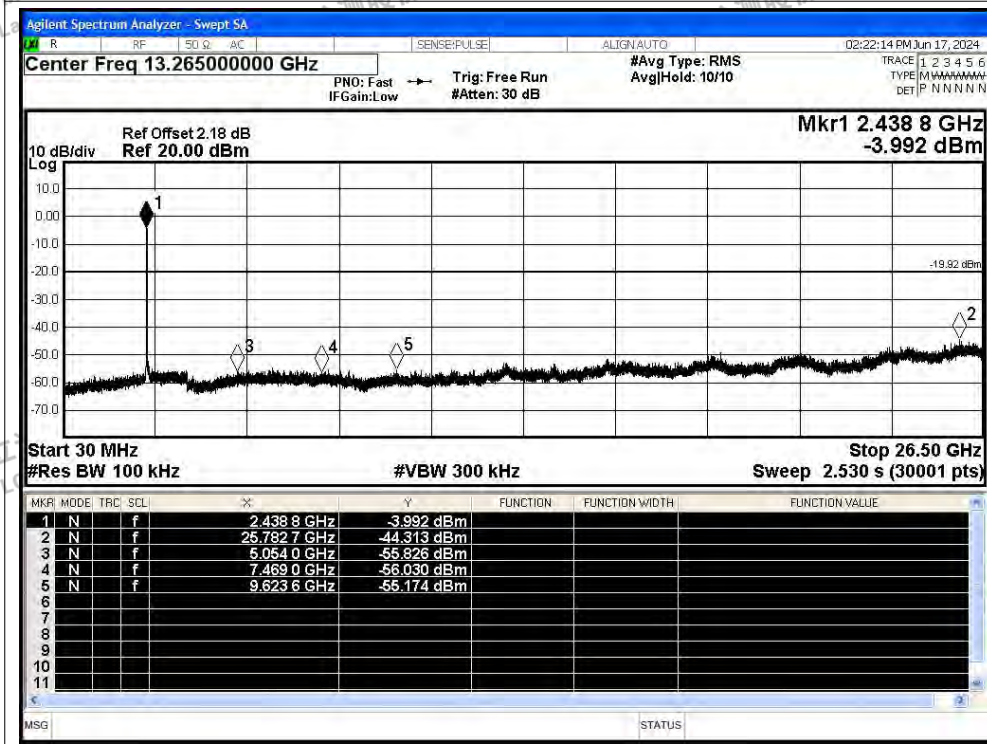




Tx. Spurious NVNT n20 2462MHz Ant4 Ref

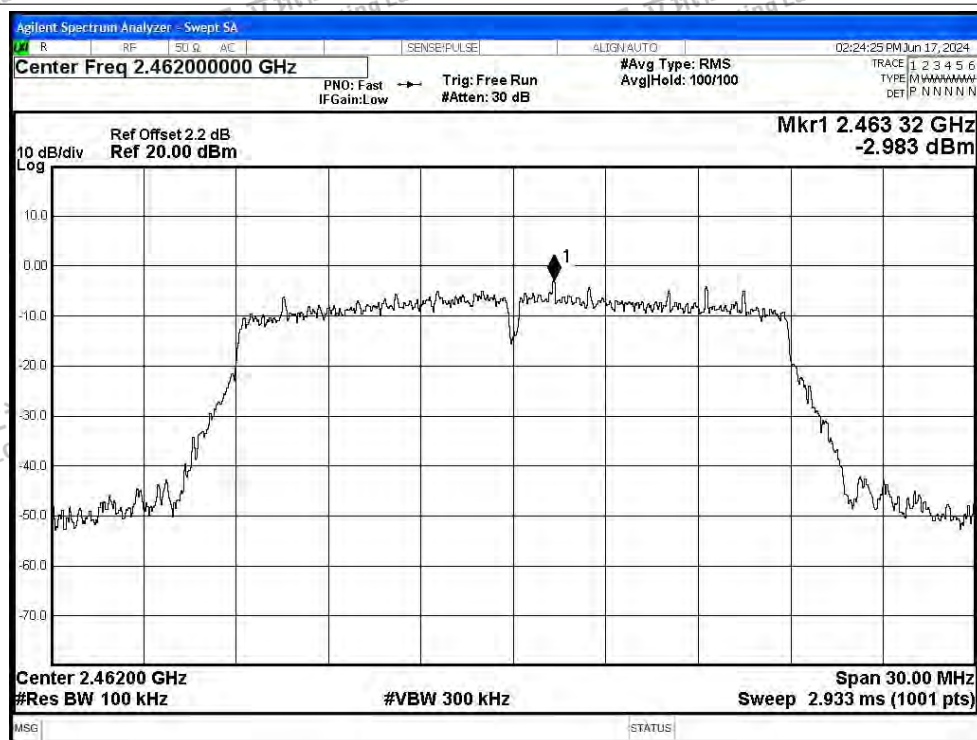

Tx. Spurious NVNT n20 2462MHz Ant4 Emission

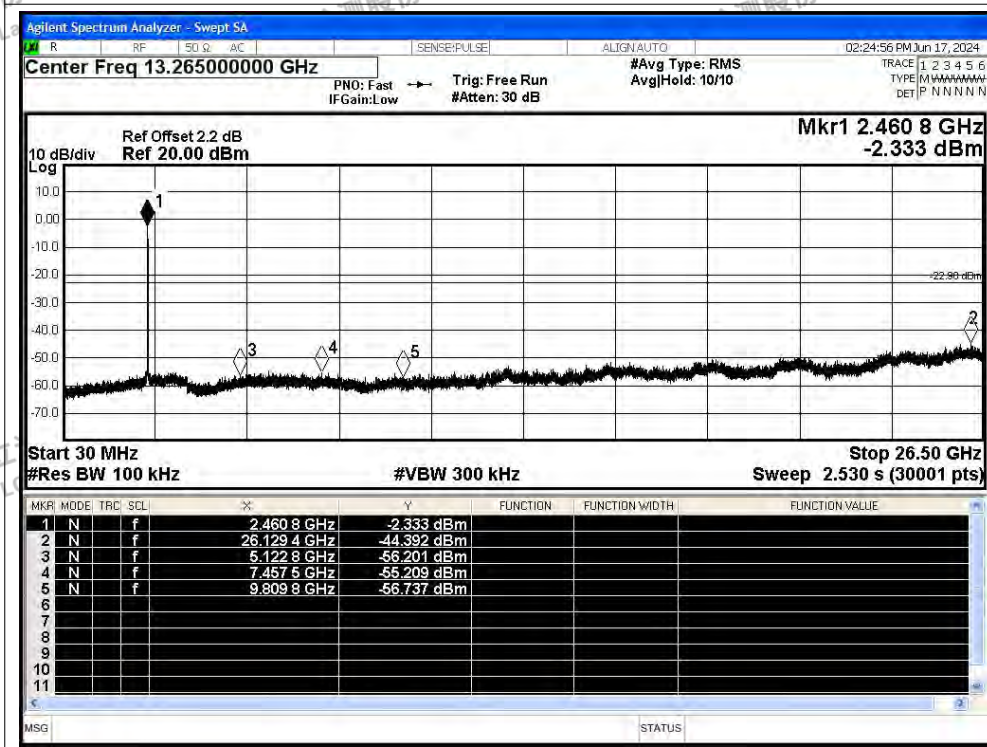

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT n40 2422MHz Ant4 Ref

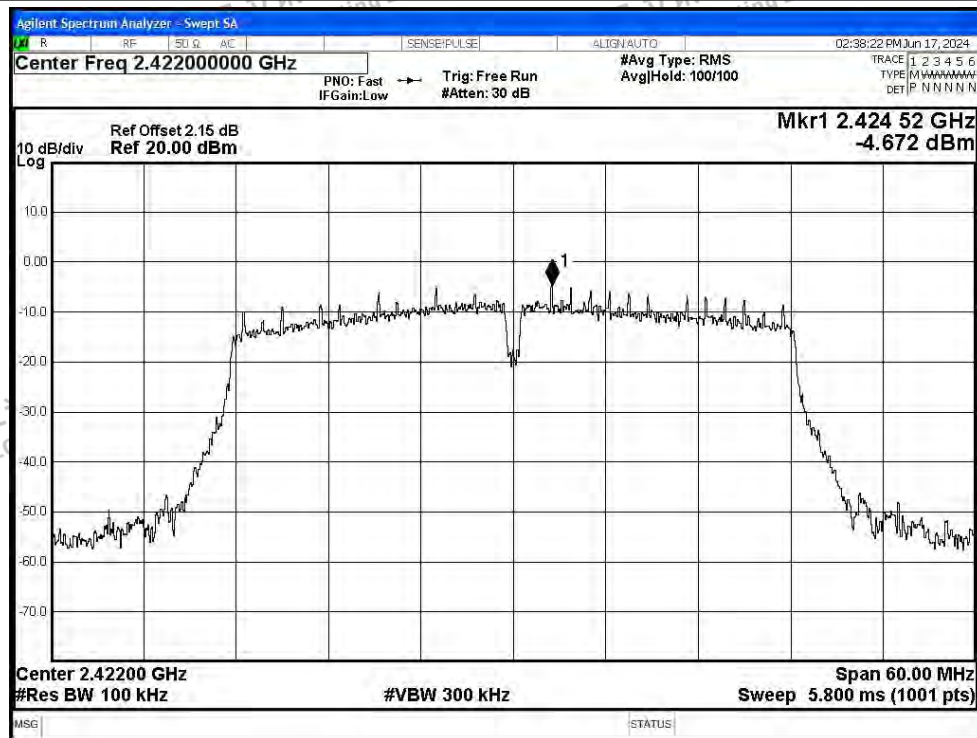


Tx. Spurious NVNT n40 2422MHz Ant4 Emission

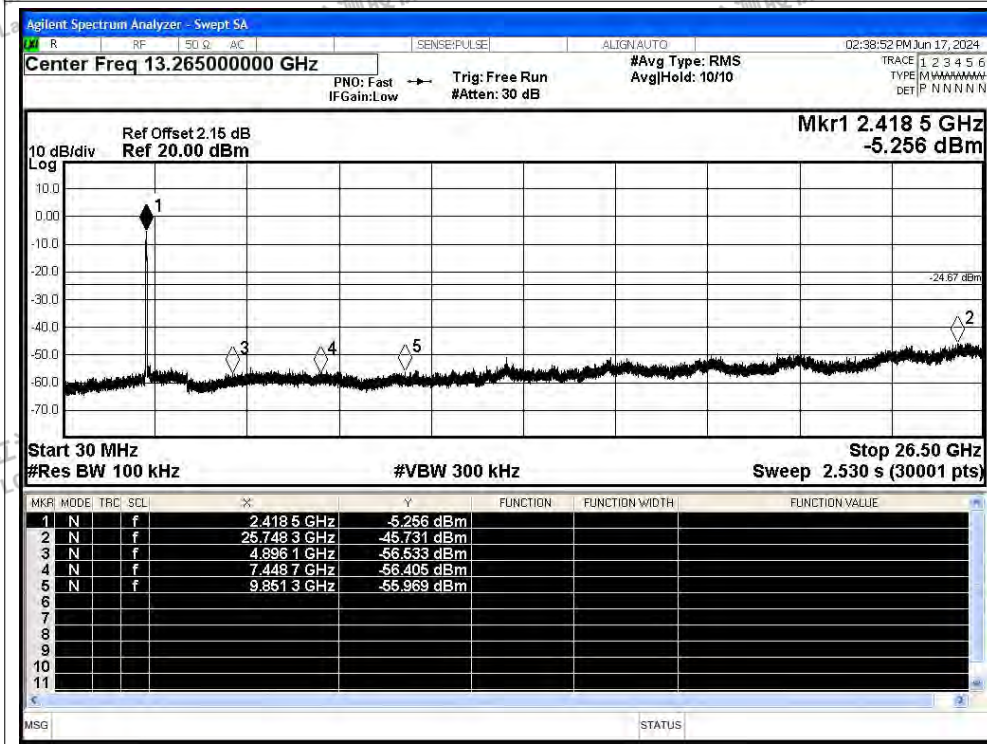




Tx. Spurious NVNT n40 2437MHz Ant4 Ref

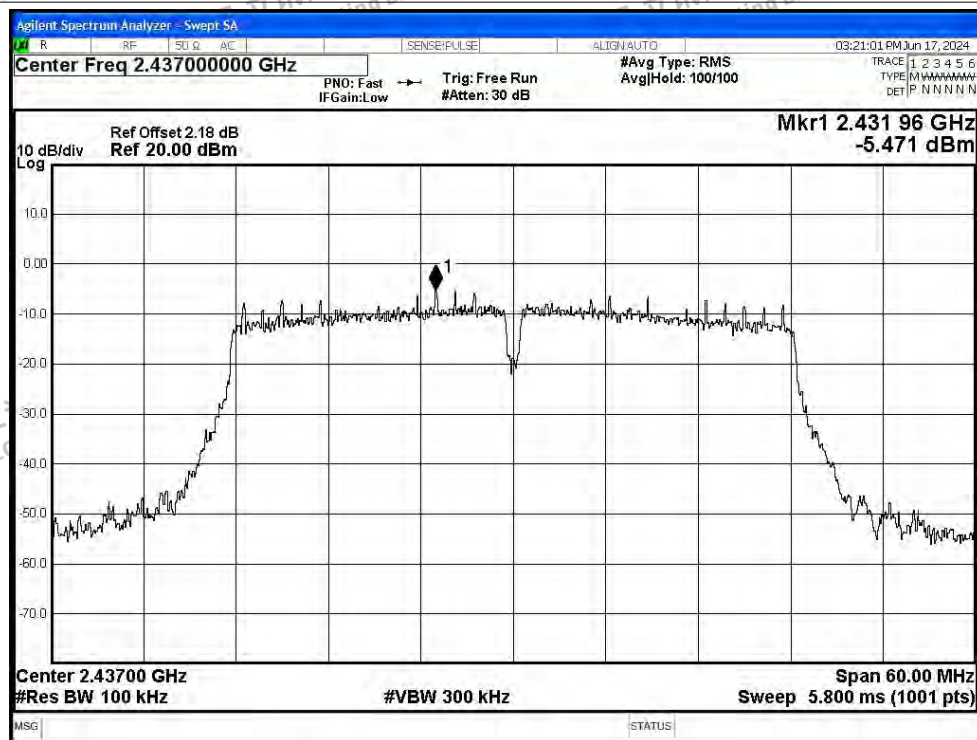


Tx. Spurious NVNT n40 2437MHz Ant4 Emission

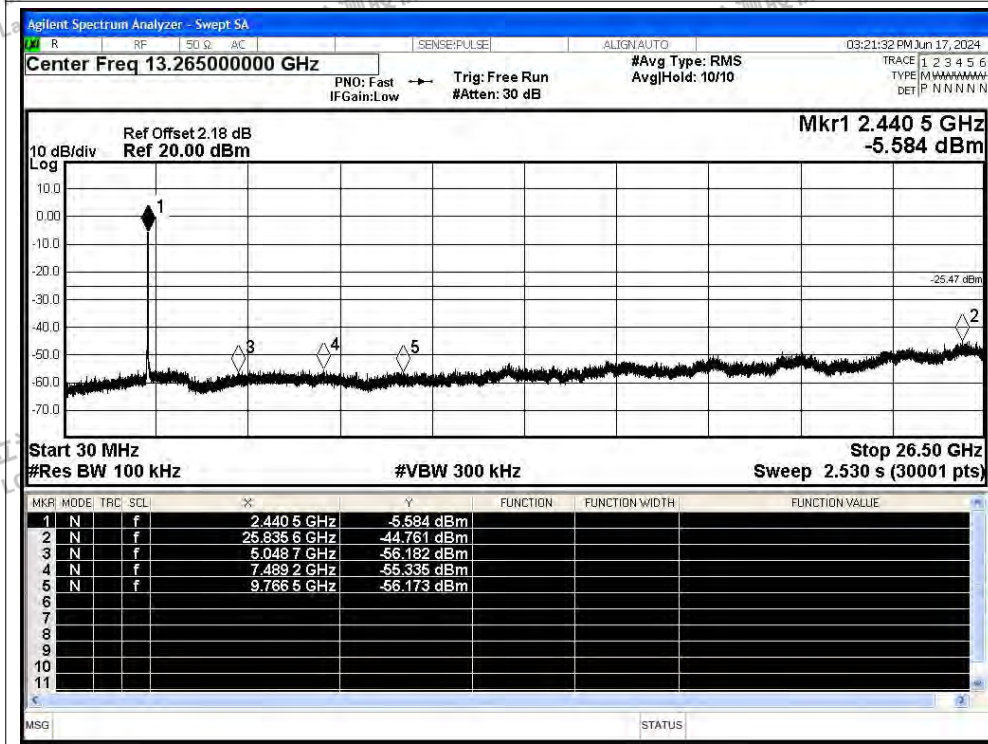




Tx. Spurious NVNT n40 2452MHz Ant4 Ref

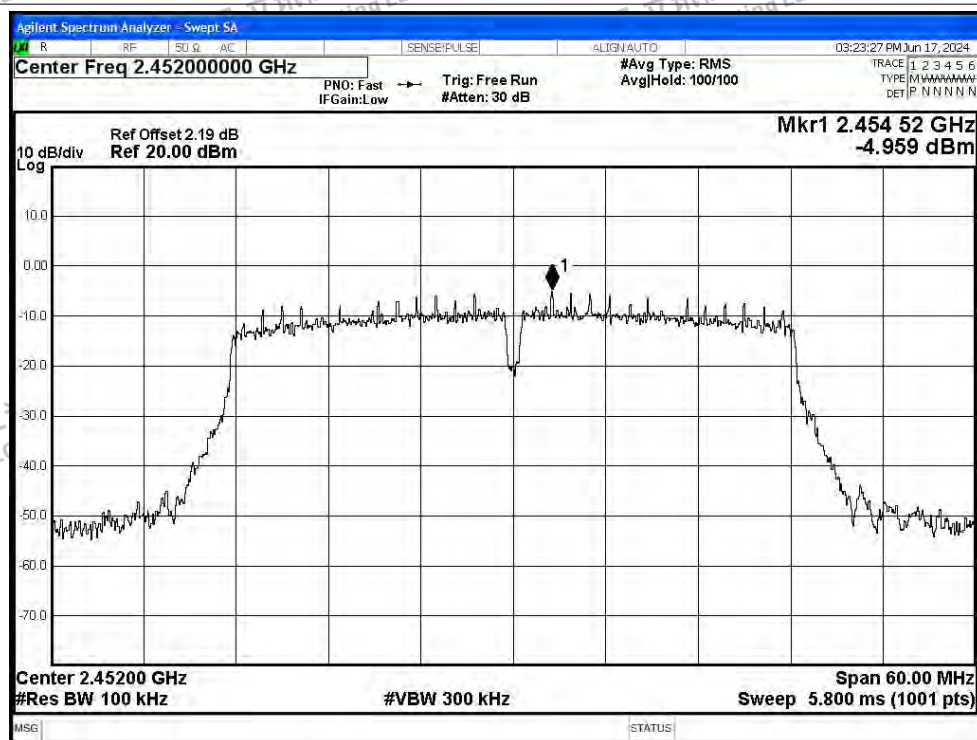

Tx. Spurious NVNT n40 2452MHz Ant4 Emission

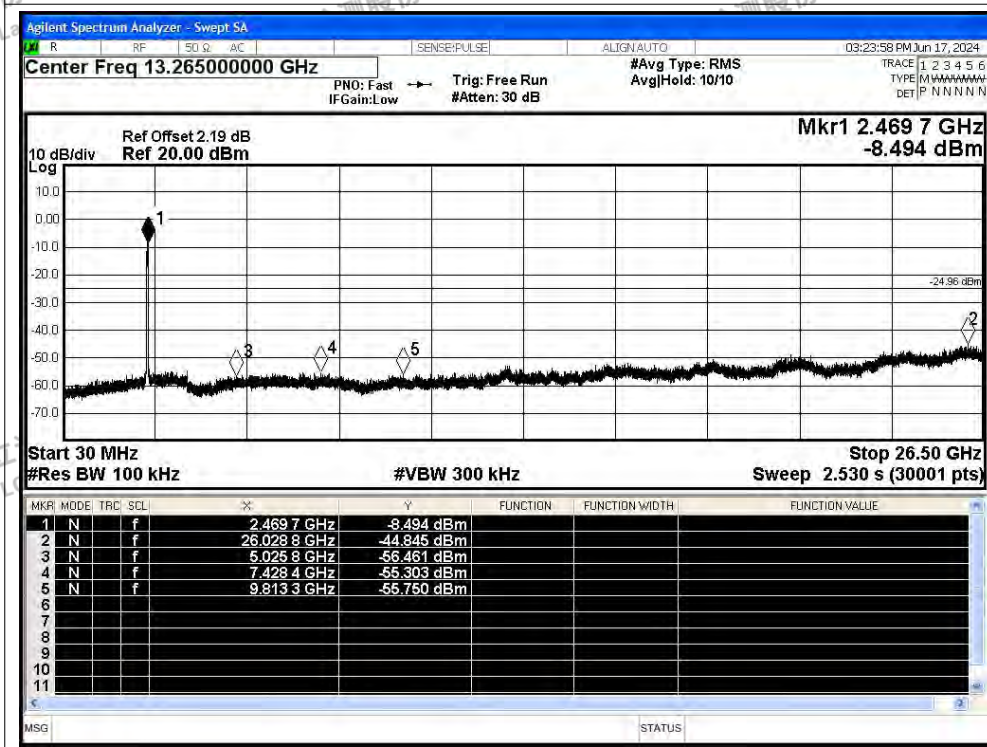

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx: Spurious NVNT ax20 2412MHz Ant4 Ref

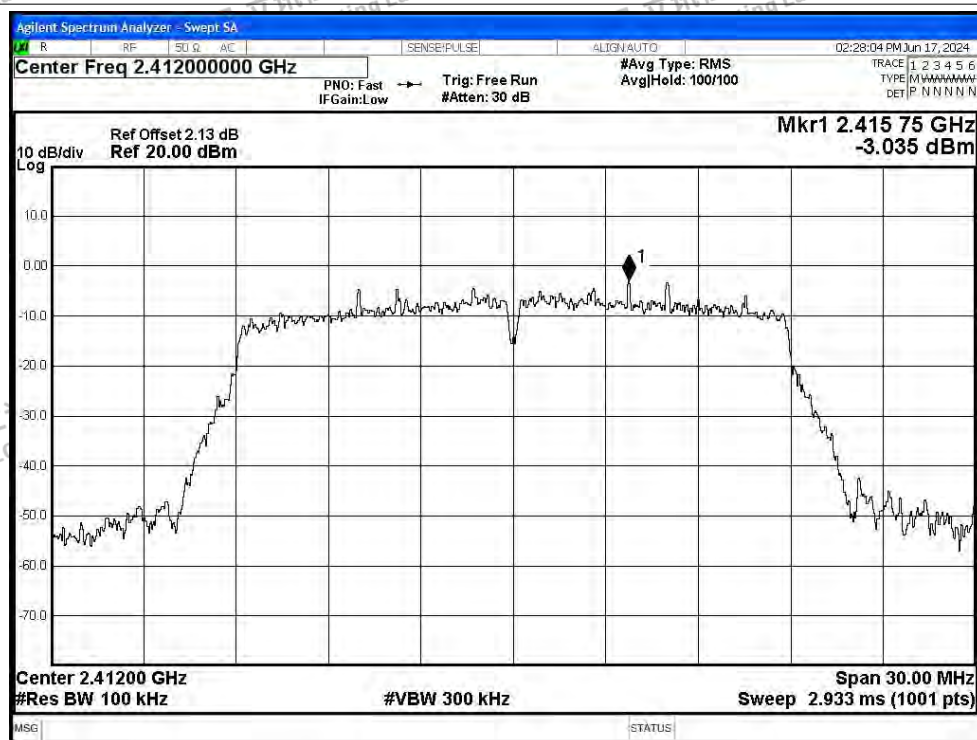

Tx: Spurious NVNT ax20 2412MHz Ant4 Emission

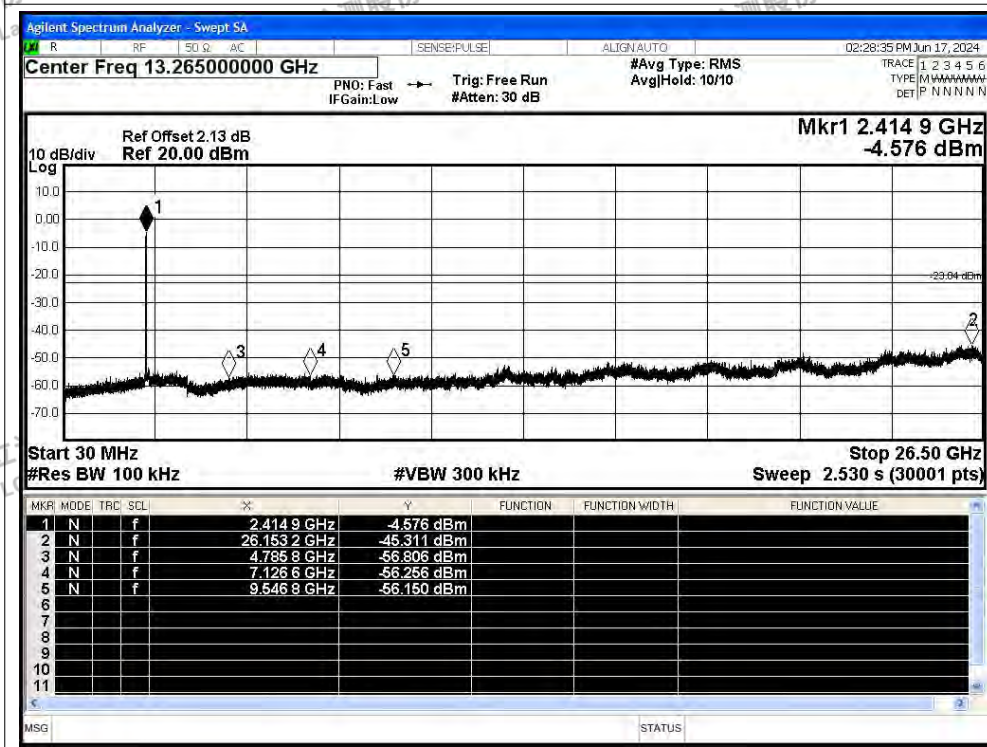

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx: Spurious NVNT ax20 2437MHz Ant4 Ref

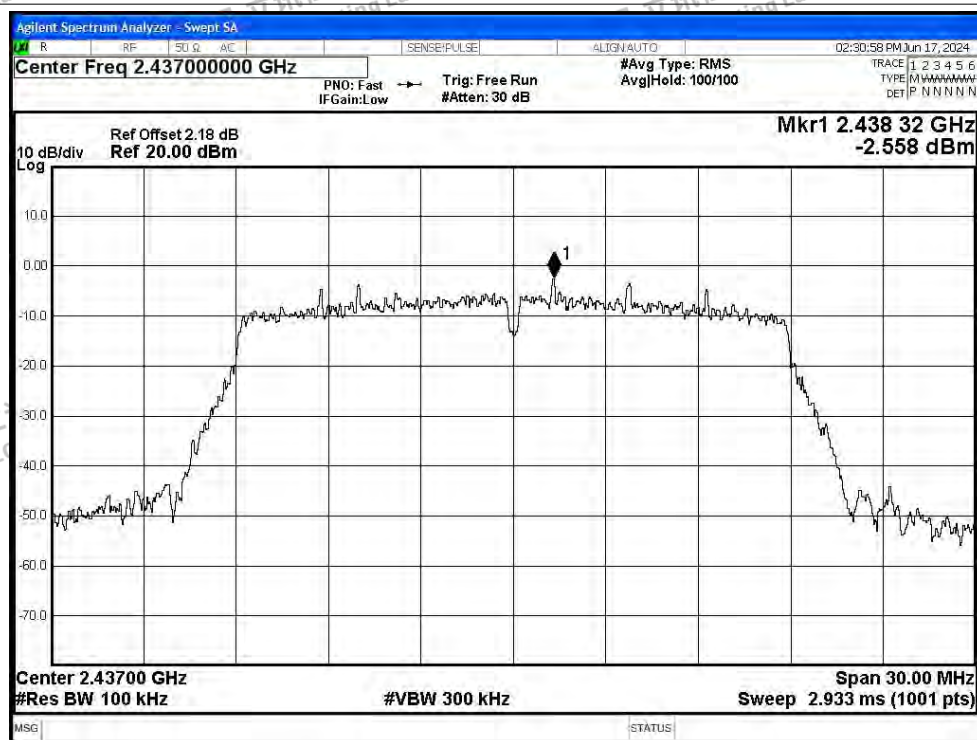

Tx: Spurious NVNT ax20 2437MHz Ant4 Emission

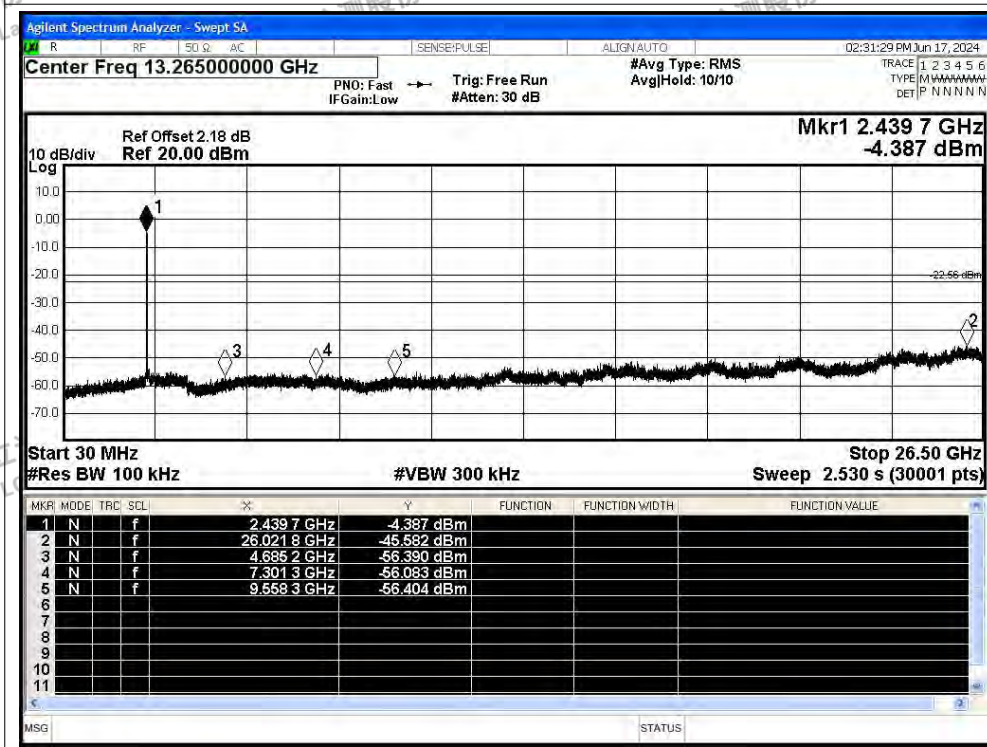

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx: Spurious NVNT ax20 2462MHz Ant4 Ref

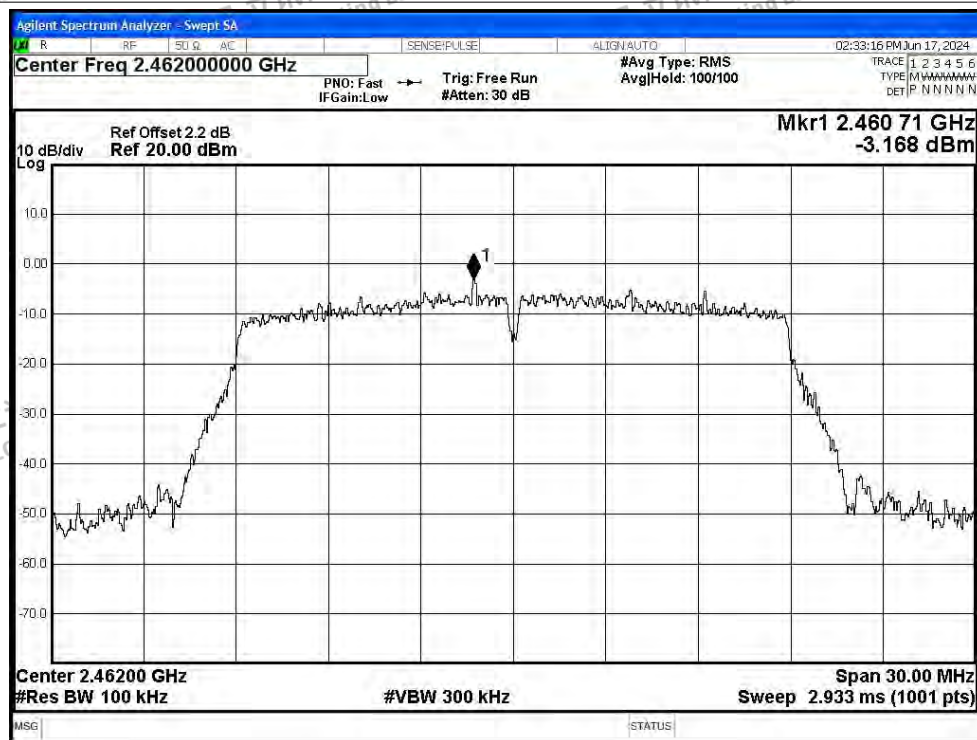

Tx: Spurious NVNT ax20 2462MHz Ant4 Emission

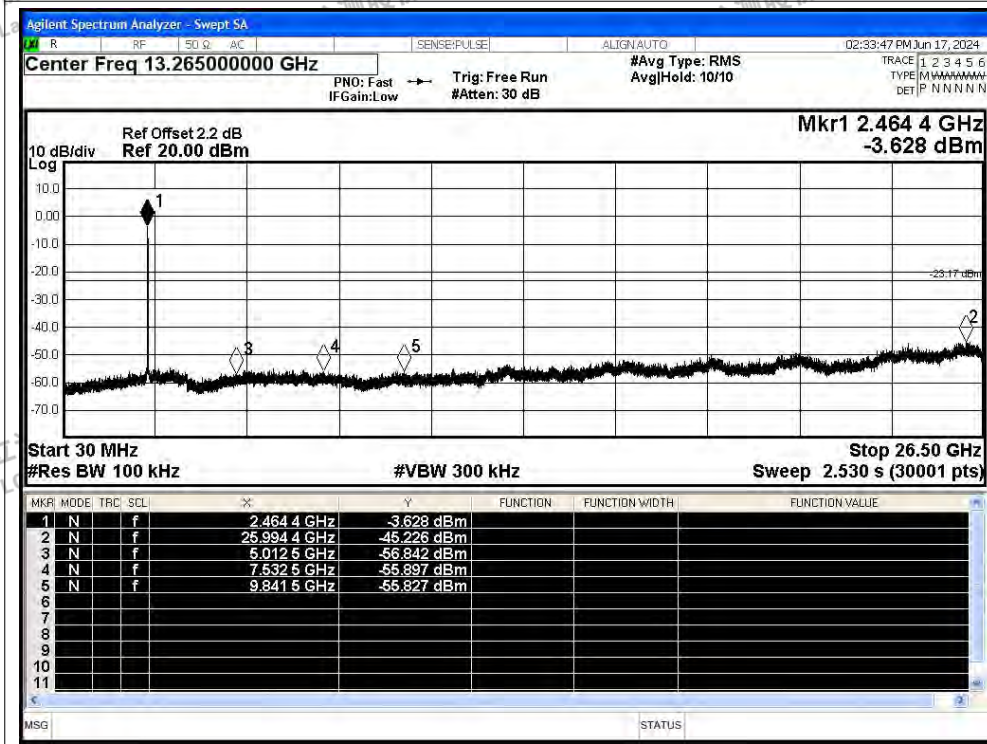

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx. Spurious NVNT ax40 2422MHz Ant4 Ref

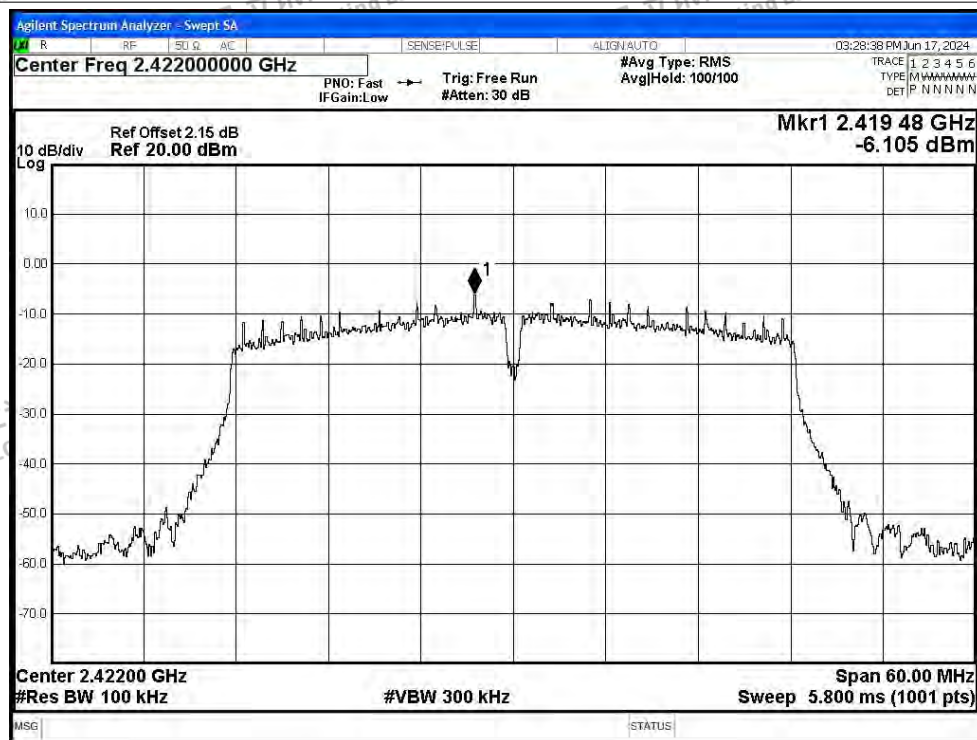

Tx. Spurious NVNT ax40 2422MHz Ant4 Emission

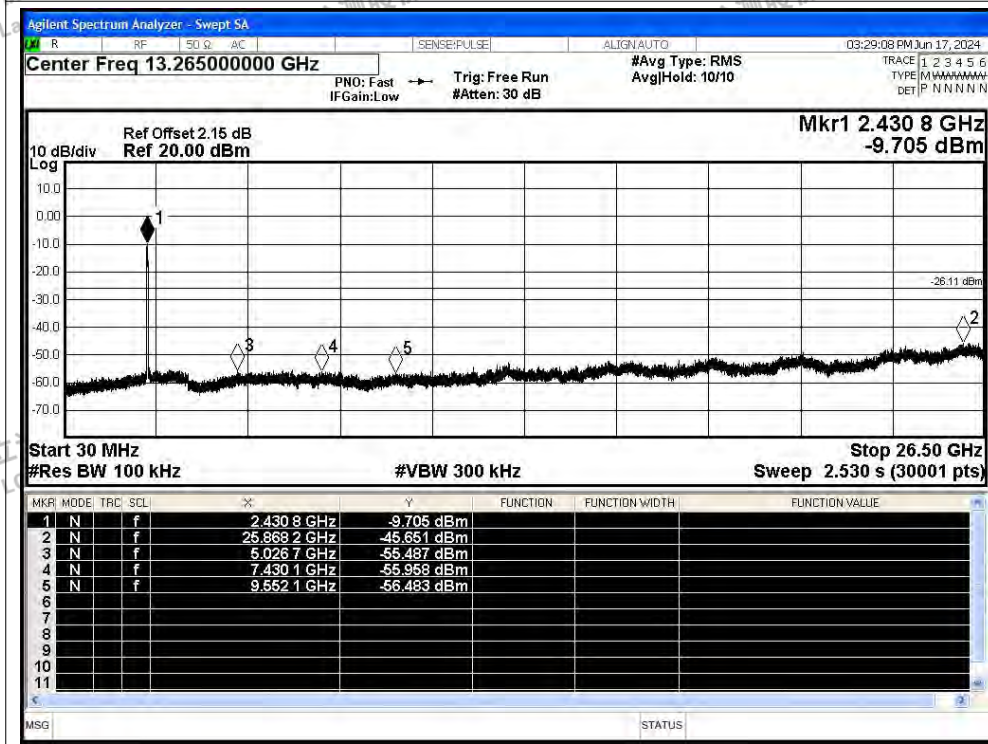

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Tx: Spurious NVNT ax40 2437MHz Ant4 Ref

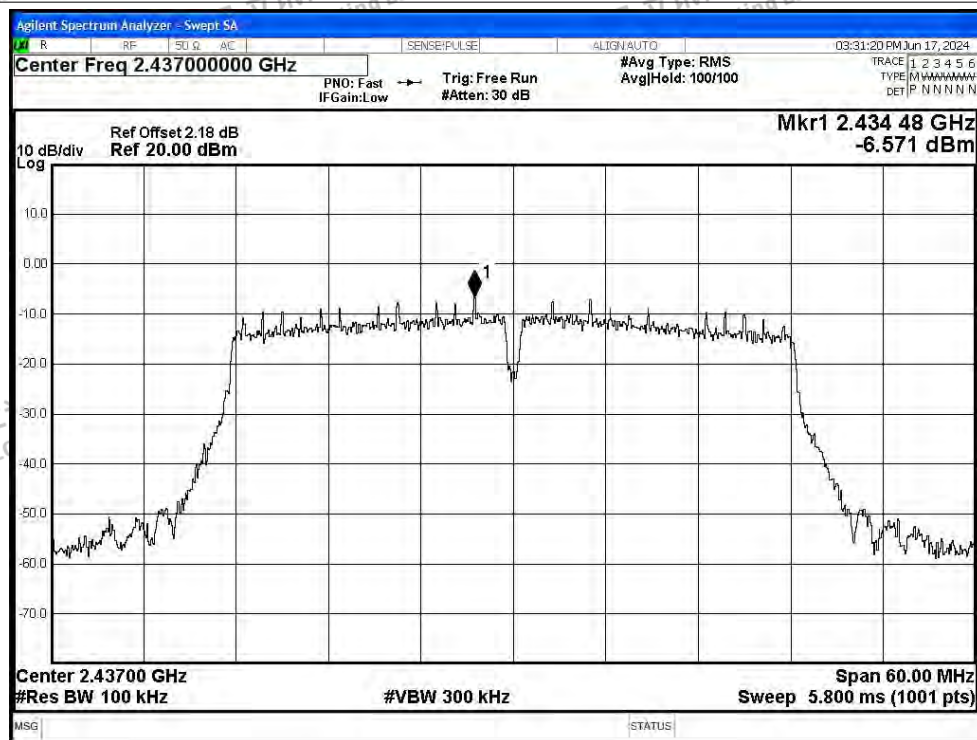


Tx: Spurious NVNT ax40 2437MHz Ant4 Emission

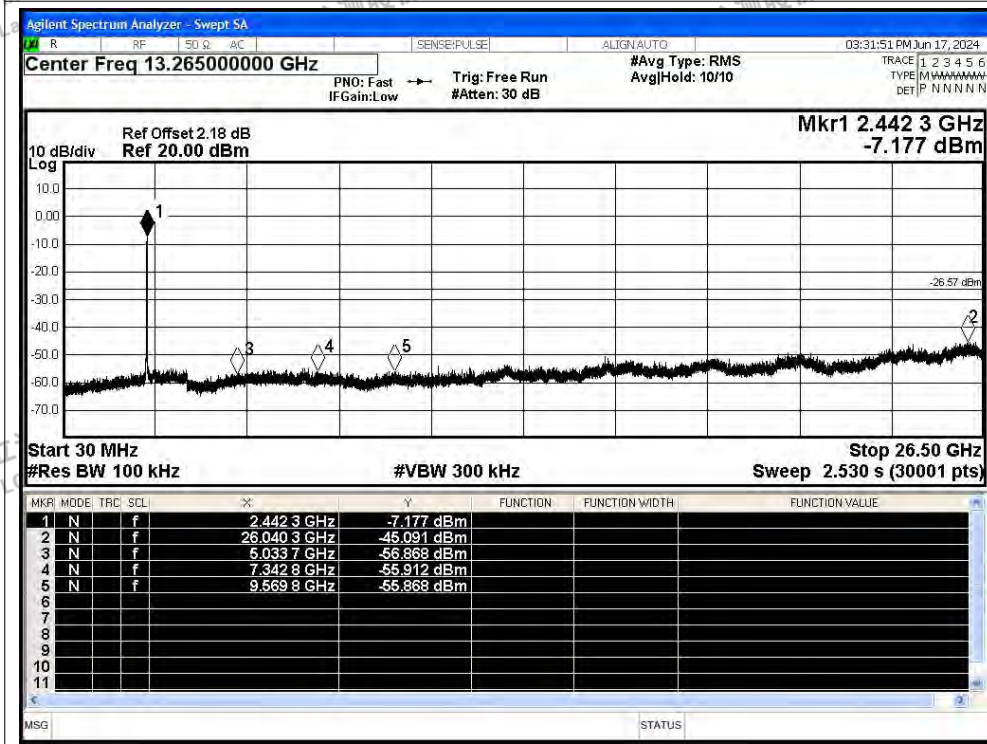




Tx: Spurious NVNT ax40 2452MHz Ant4 Ref

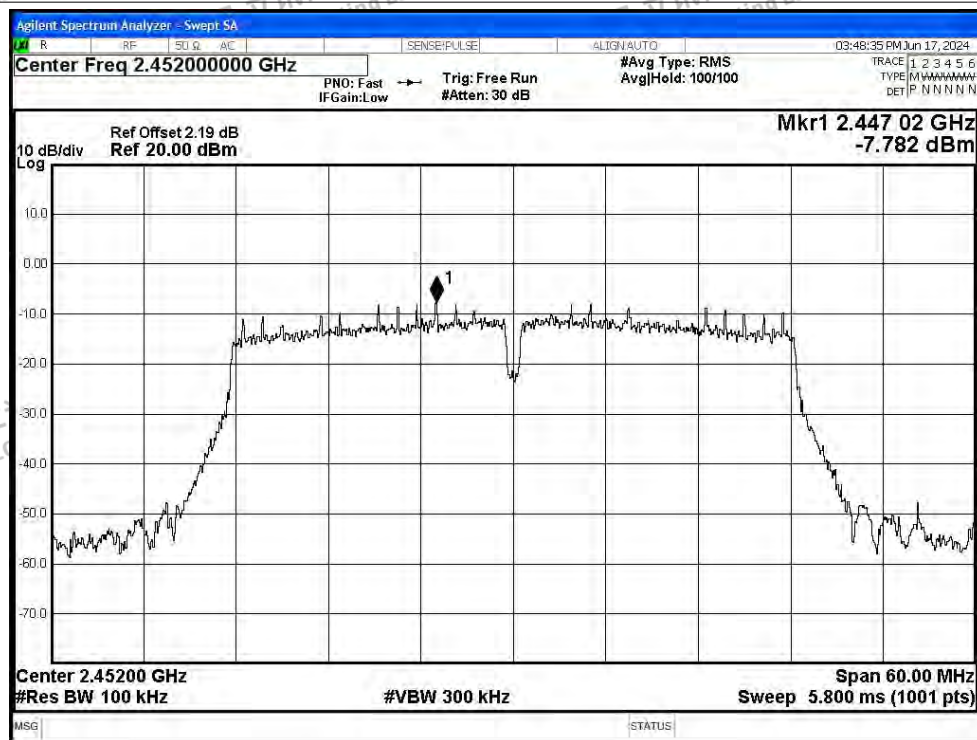

Tx: Spurious NVNT ax40 2452MHz Ant4 Emission

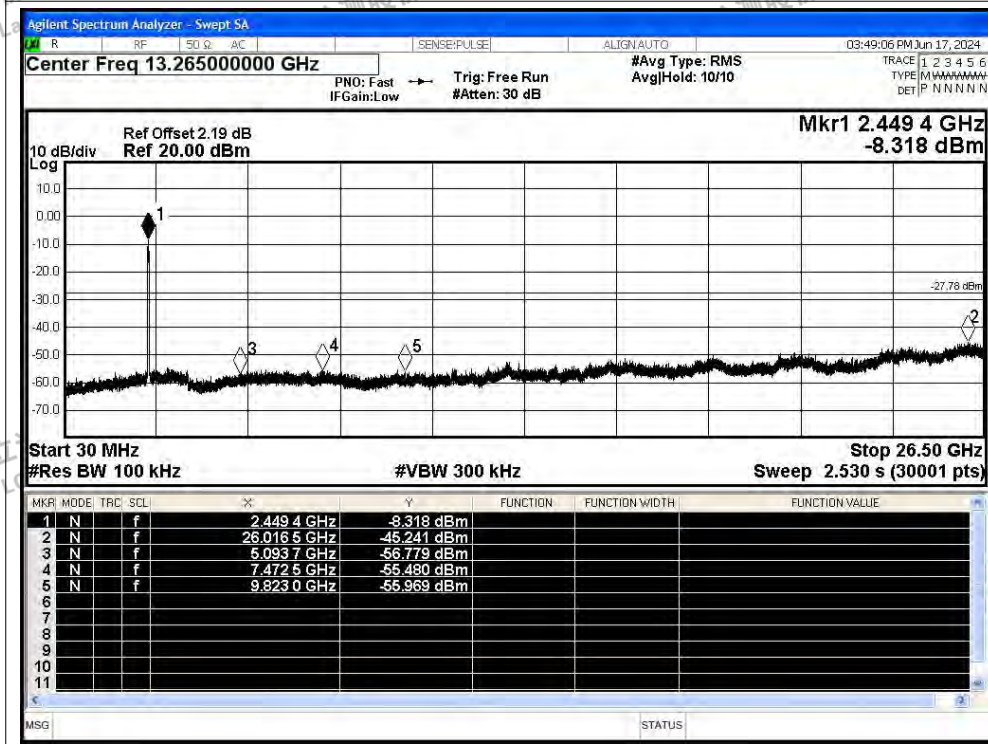



C.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	b	2412	Ant2	99.58	0	0.15
NVNT	b	2437	Ant2	99.58	0	0.15
NVNT	b	2462	Ant2	99.58	0	0.15
NVNT	g	2412	Ant2	97.56	0.11	0.73
NVNT	g	2437	Ant2	97.56	0.11	0.73
NVNT	g	2462	Ant2	97.7	0.1	0.73
NVNT	n20	2412	Ant2	97.4	0.11	0.78
NVNT	n20	2437	Ant2	97.4	0.11	0.78
NVNT	n20	2462	Ant2	97.4	0.11	0.78
NVNT	n40	2422	Ant2	96.47	0.16	1.08
NVNT	n40	2437	Ant2	96.47	0.16	1.08
NVNT	n40	2452	Ant2	96.67	0.15	1.08
NVNT	ax20	2412	Ant2	97.4	0.11	0.78
NVNT	ax20	2437	Ant2	97.55	0.11	0.78
NVNT	ax20	2462	Ant2	97.4	0.11	0.78
NVNT	ax40	2422	Ant2	96.47	0.16	1.08
NVNT	ax40	2437	Ant2	96.67	0.15	1.08
NVNT	ax40	2452	Ant2	96.47	0.16	1.08






Test Graphs

Duty Cycle NVNT b 2412MHz Ant2

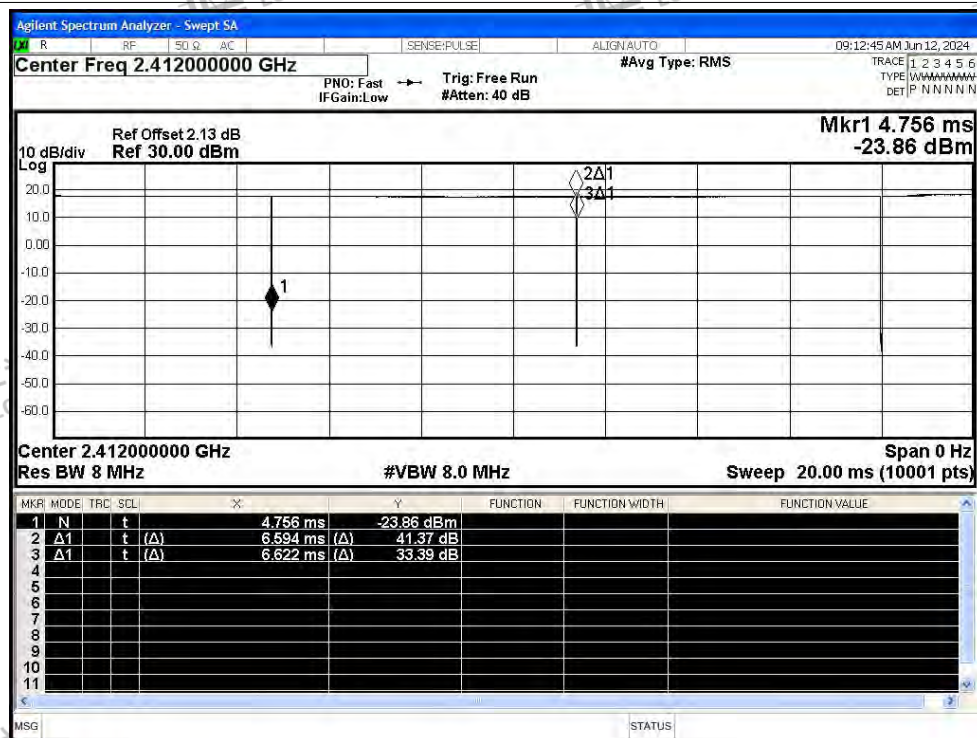

Duty Cycle NVNT b 2437MHz Ant2

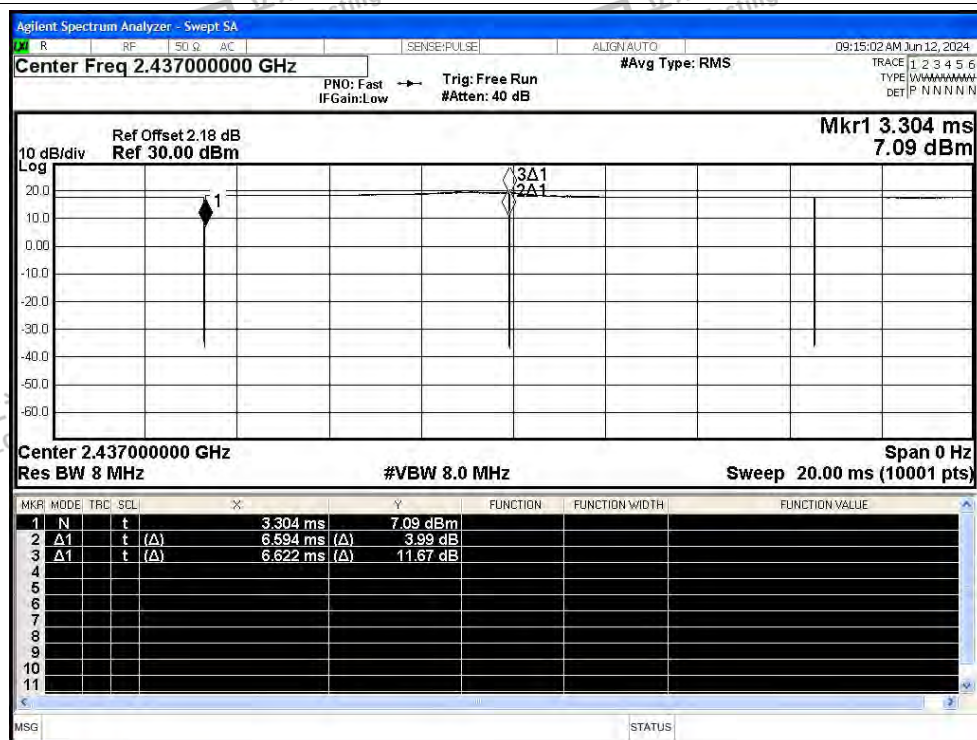

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT b 2462MHz Ant2

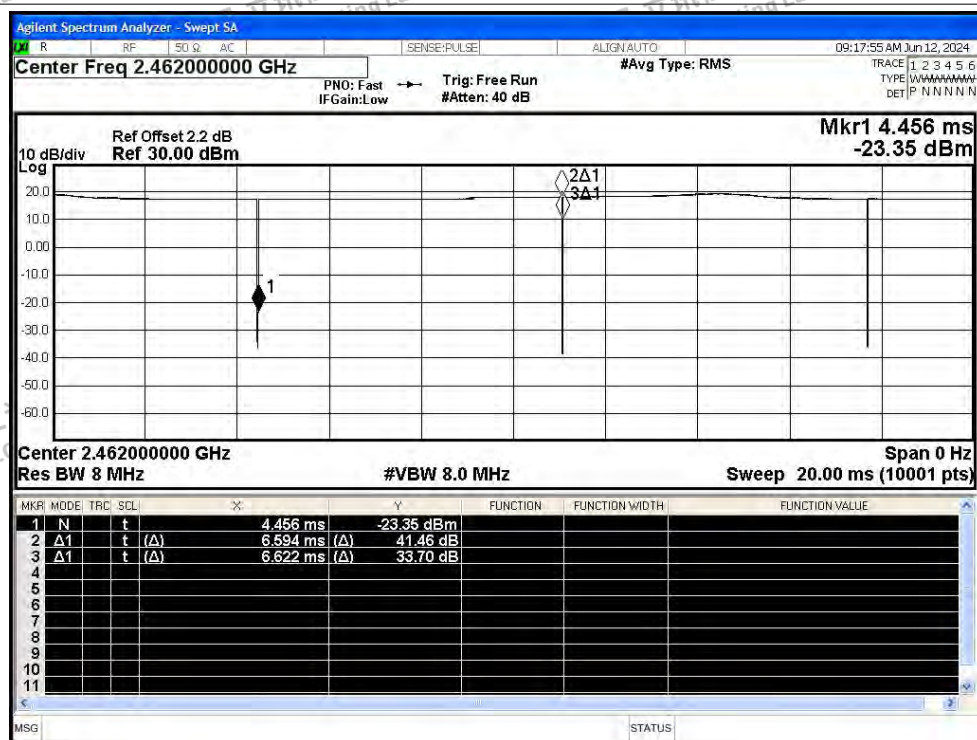

Duty Cycle NVNT g 2412MHz Ant2

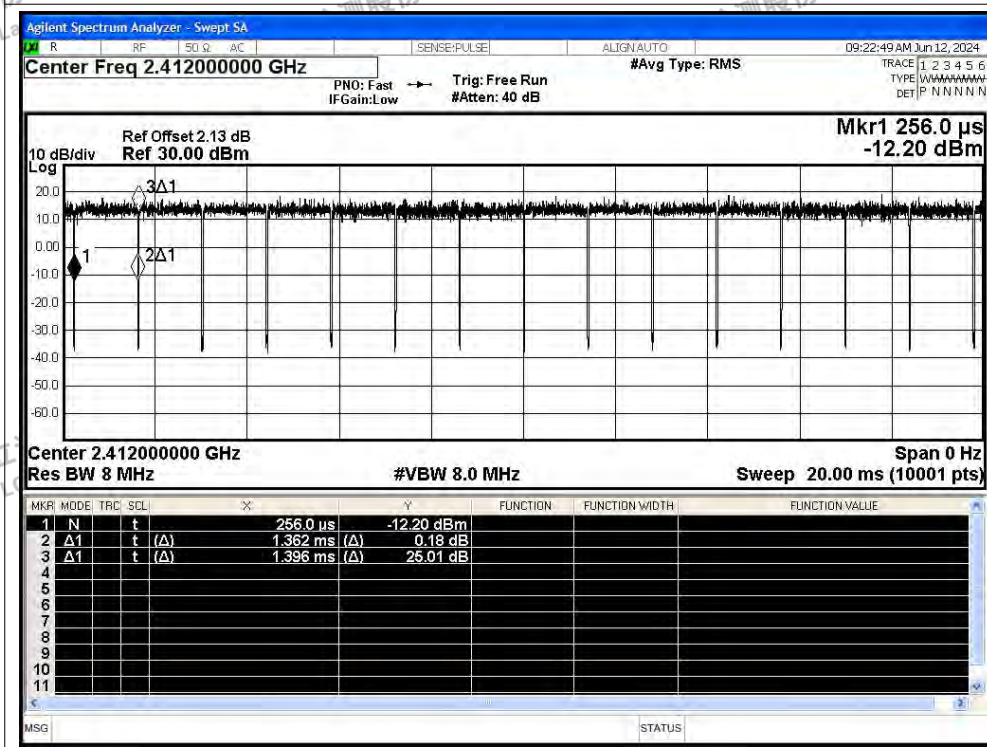

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT g 2437MHz Ant2

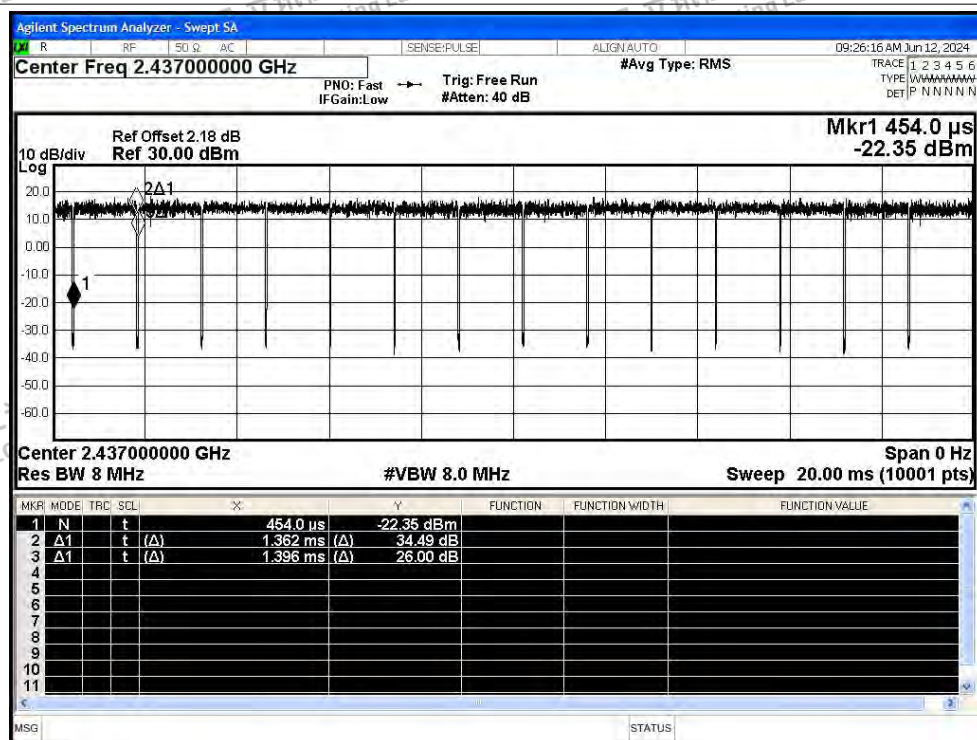

Duty Cycle NVNT g 2462MHz Ant2

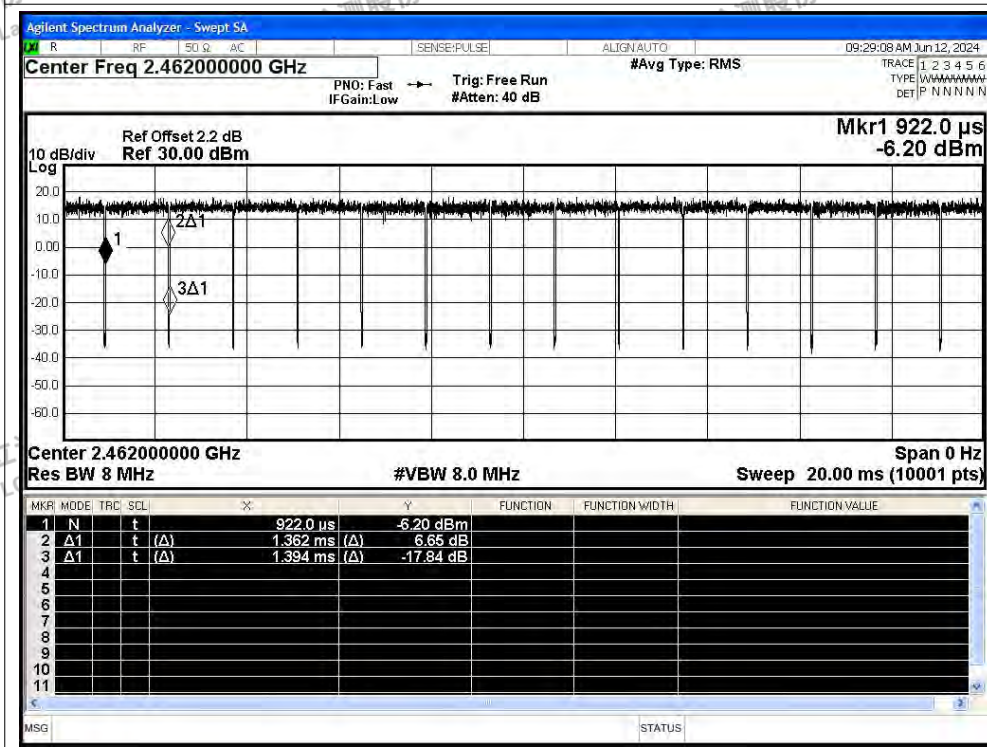

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 2412MHz Ant2

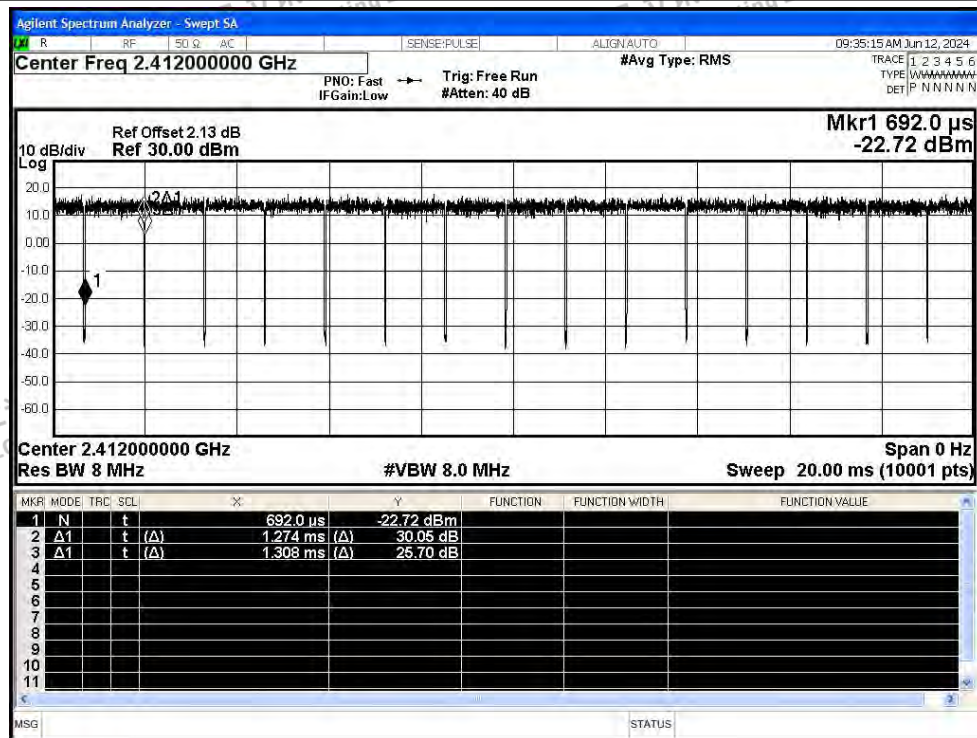


Duty Cycle NVNT n20 2437MHz Ant2

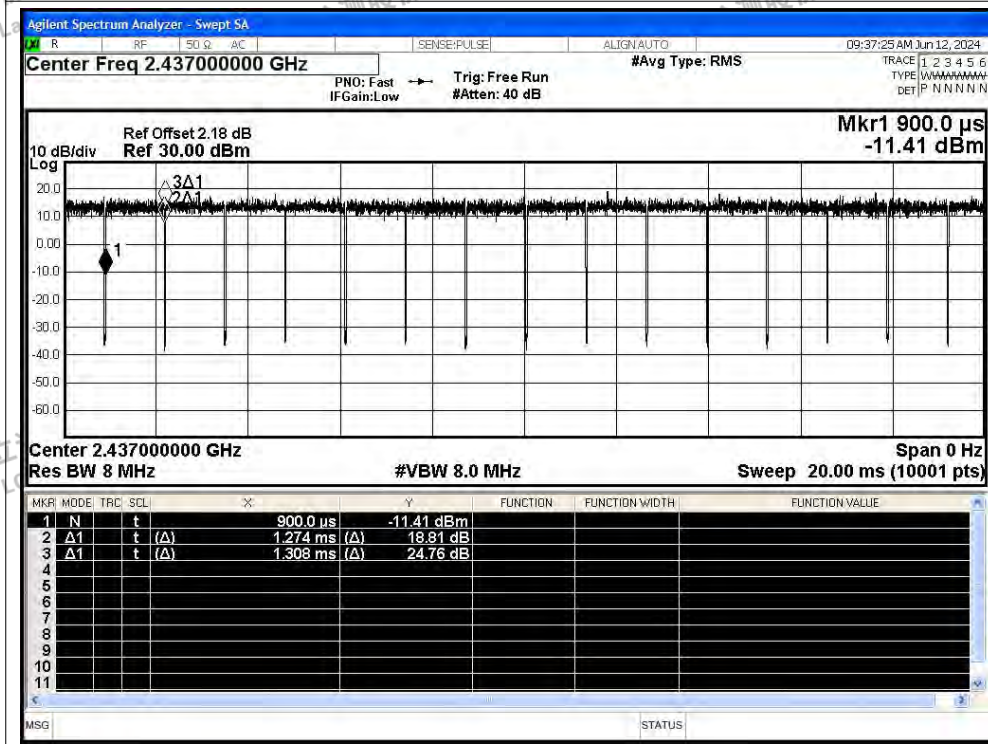




Duty Cycle NVNT n20 2462MHz Ant2

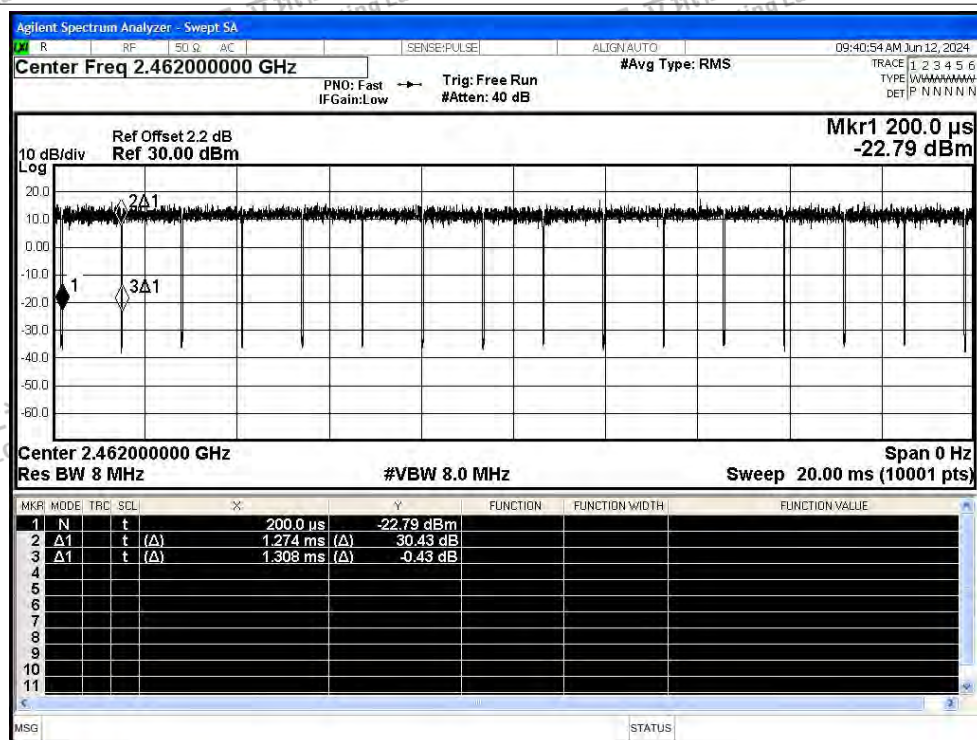

Duty Cycle NVNT n40 2422MHz Ant2

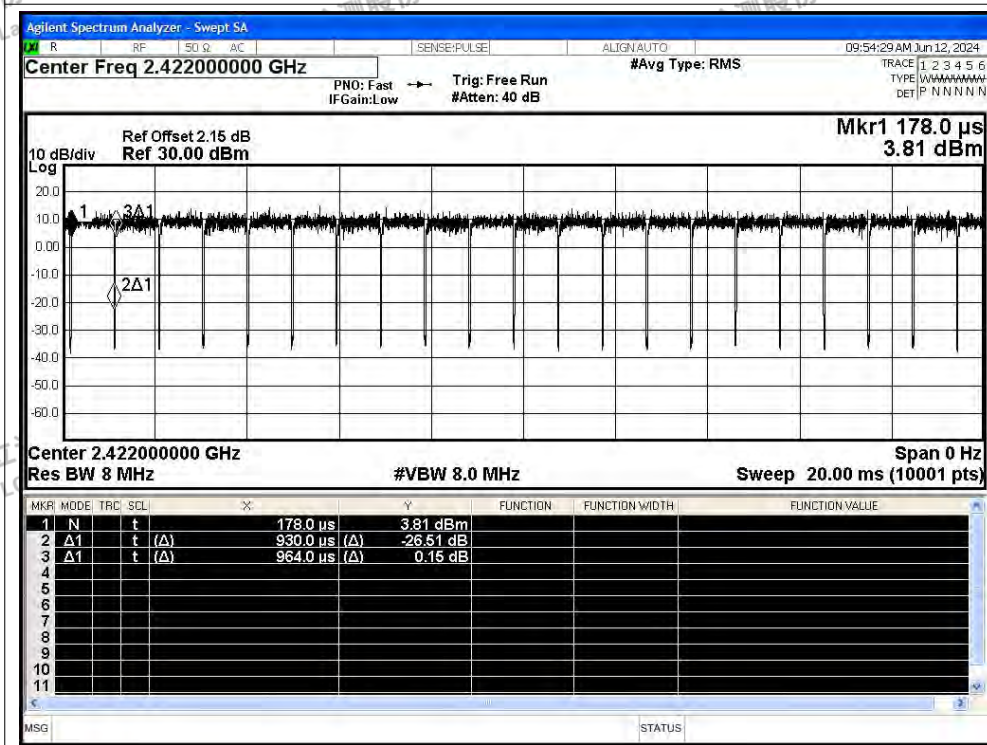

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 2437MHz Ant2

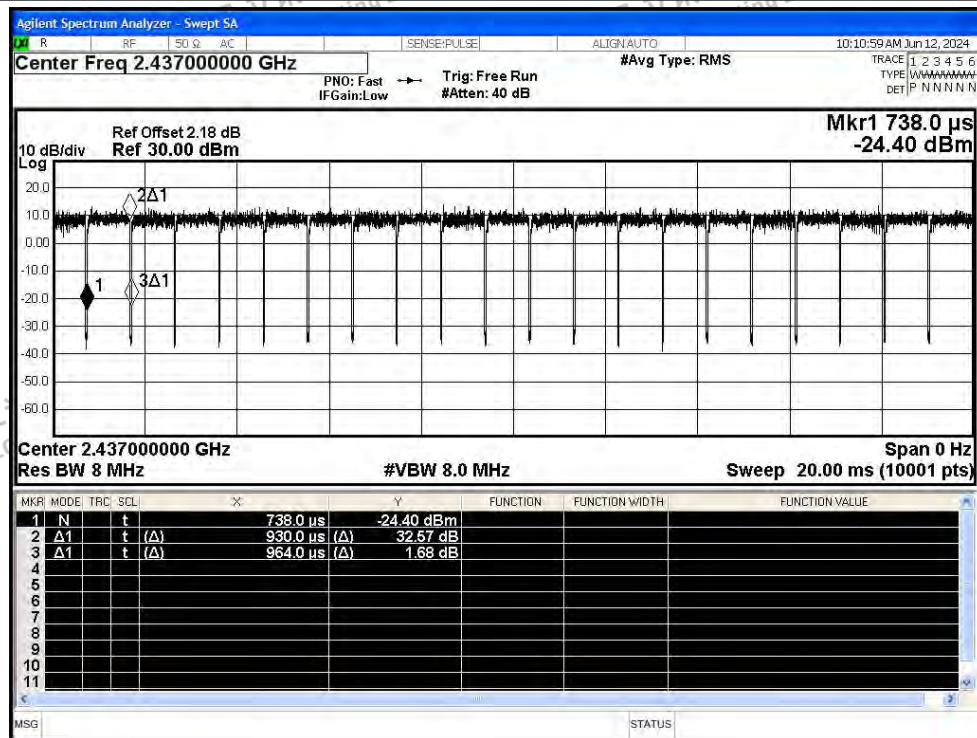

Duty Cycle NVNT n40 2452MHz Ant2

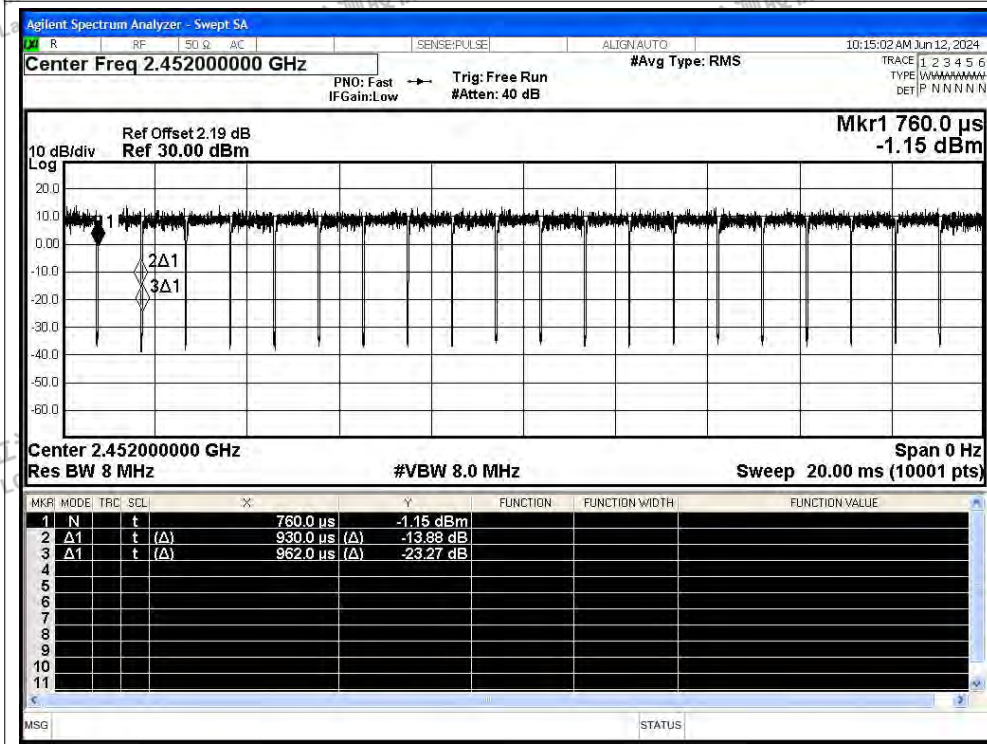

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 2412MHz Ant2

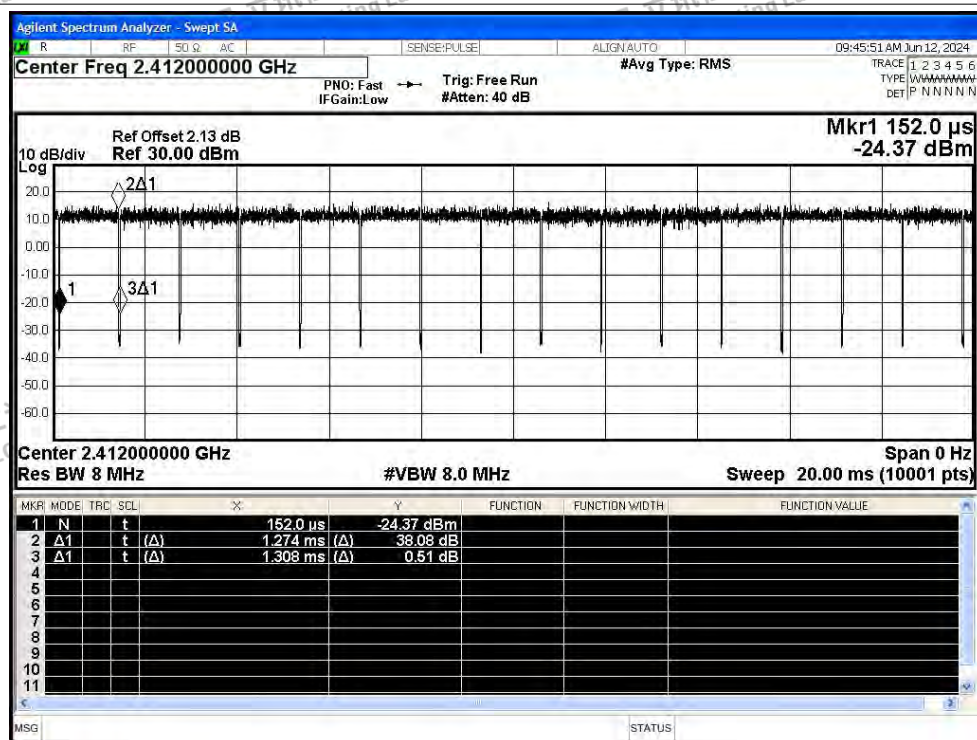

Duty Cycle NVNT ax20 2437MHz Ant2

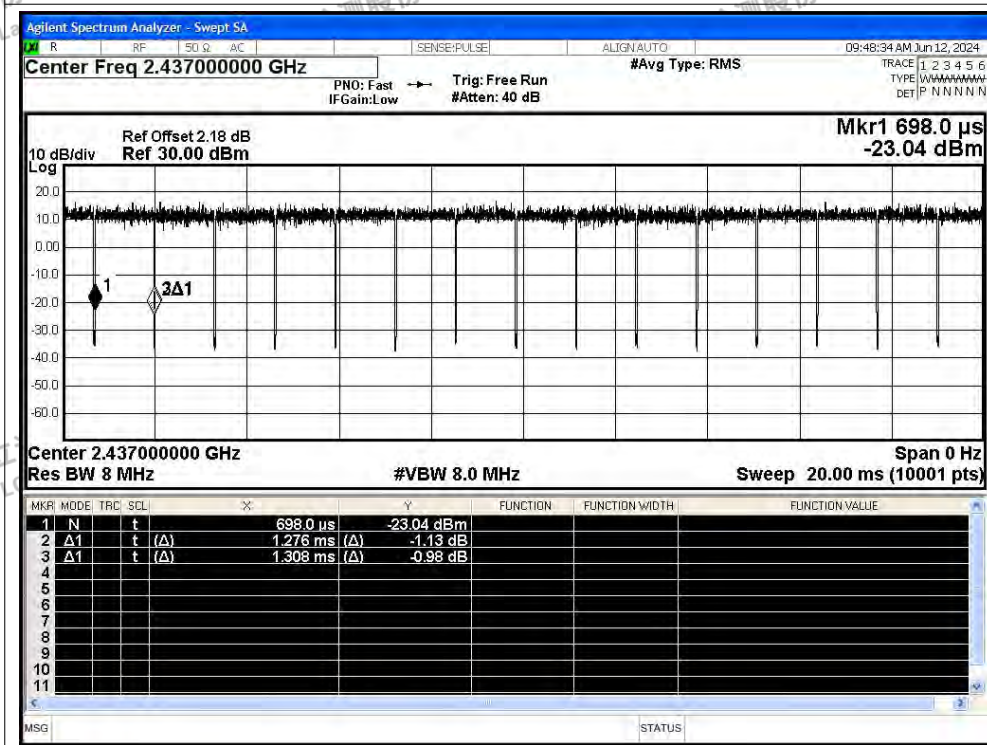

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 2462MHz Ant2

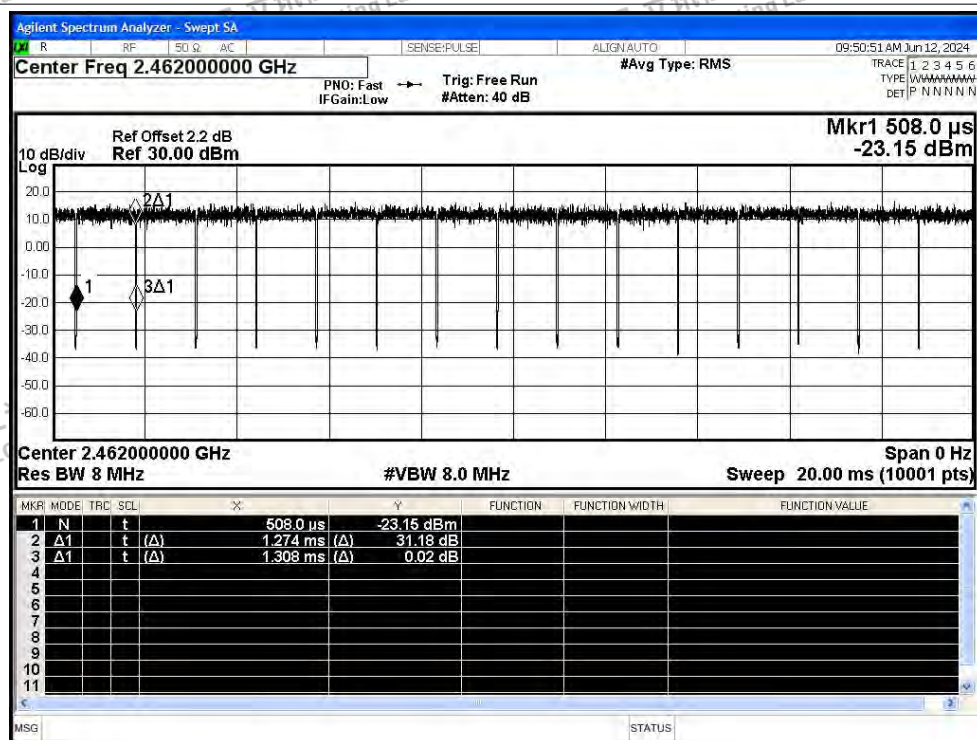

Duty Cycle NVNT ax40 2422MHz Ant2

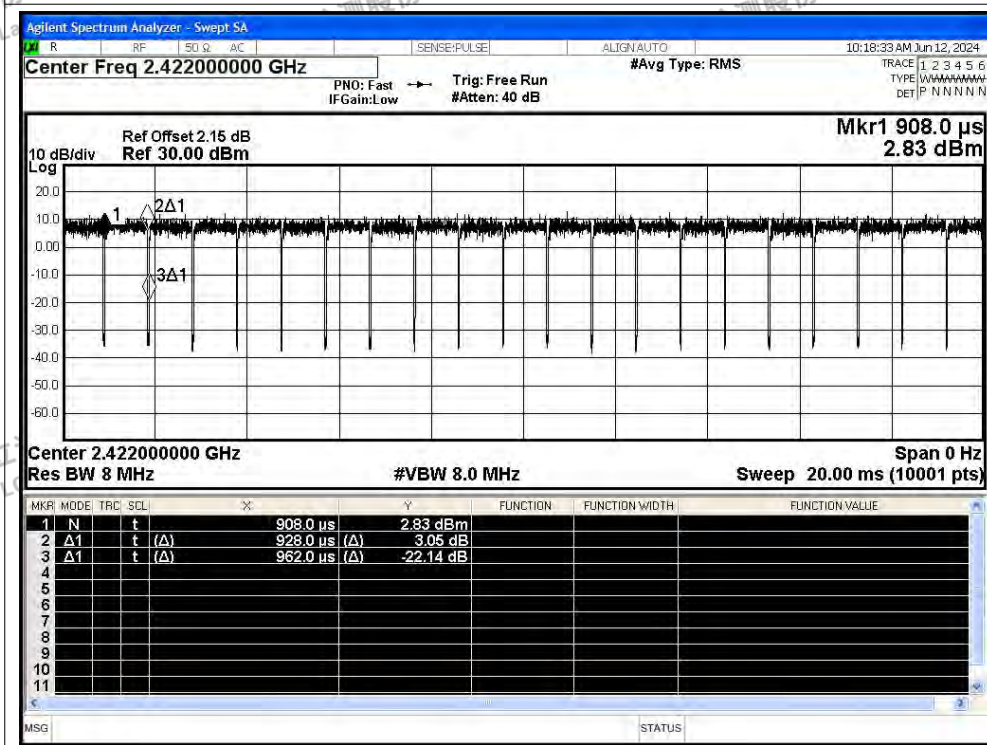

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 2437MHz Ant2

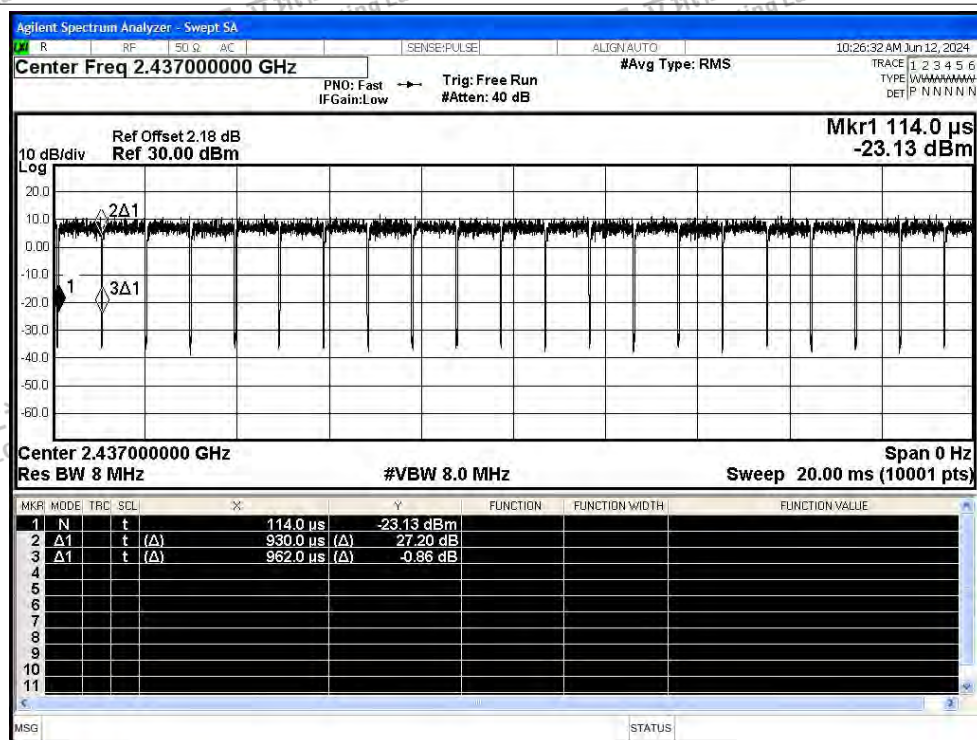

Duty Cycle NVNT ax40 2452MHz Ant2

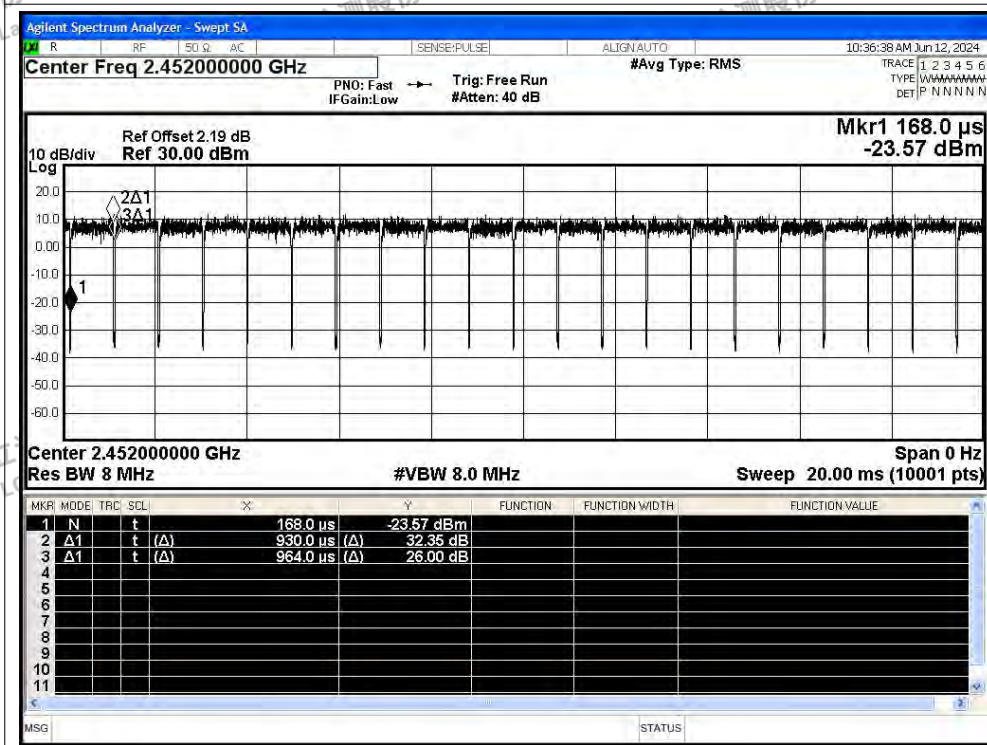

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	b	2412	Ant3	99.58	0	0.15
NVNT	b	2437	Ant3	99.61	0	0.15
NVNT	b	2462	Ant3	99.61	0	0.15
NVNT	g	2412	Ant3	98.07	0	0.61
NVNT	g	2437	Ant3	98.07	0	0.61
NVNT	g	2462	Ant3	97.95	0.09	0.62
NVNT	n20	2412	Ant3	97.81	0.1	0.66
NVNT	n20	2437	Ant3	97.81	0.1	0.66
NVNT	n20	2462	Ant3	97.94	0.09	0.66
NVNT	n40	2422	Ant3	93.79	0.28	1.58
NVNT	n40	2437	Ant3	93.79	0.28	1.58
NVNT	n40	2452	Ant3	93.49	0.29	1.58
NVNT	ax20	2412	Ant3	95.93	0.18	0.97
NVNT	ax20	2437	Ant3	96.11	0.17	0.96
NVNT	ax20	2462	Ant3	95.93	0.18	0.97
NVNT	ax40	2422	Ant3	93.57	0.29	1.56
NVNT	ax40	2437	Ant3	93.86	0.28	1.56
NVNT	ax40	2452	Ant3	93.59	0.29	1.56






Test Graphs

Duty Cycle NVNT b 2412MHz Ant3

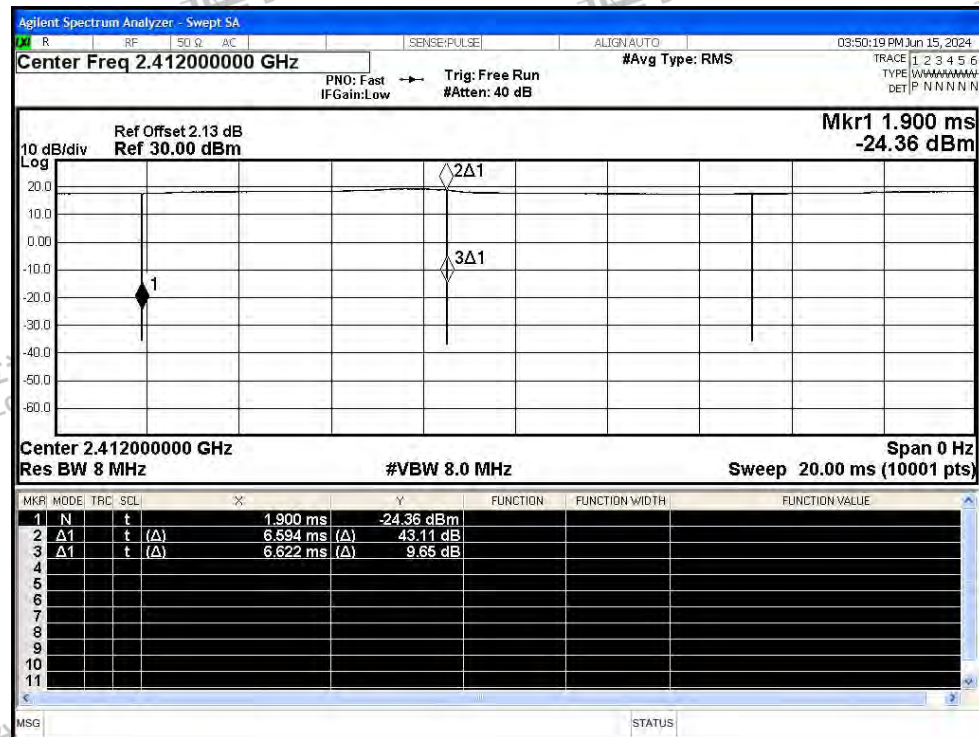

Duty Cycle NVNT b 2437MHz Ant3

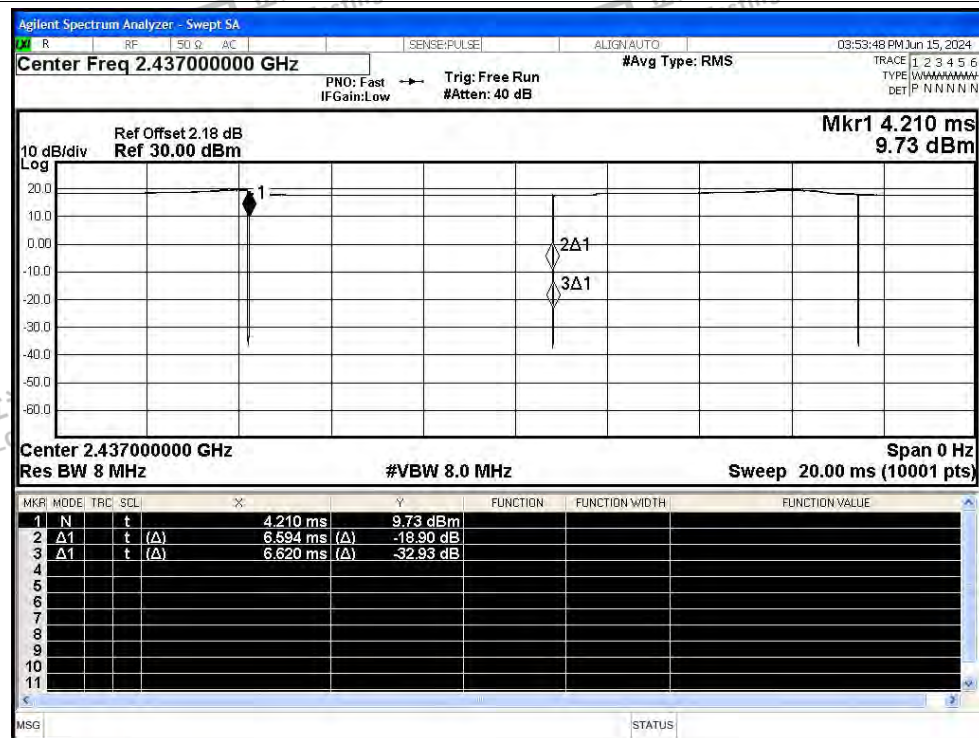

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT b 2462MHz Ant3

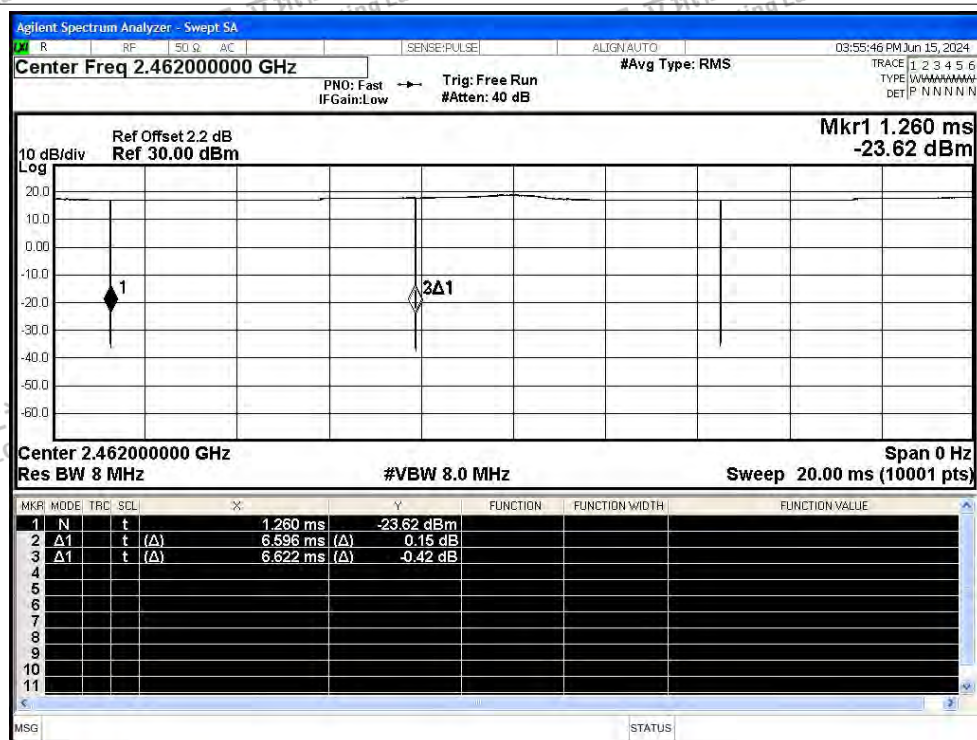

Duty Cycle NVNT g 2412MHz Ant3

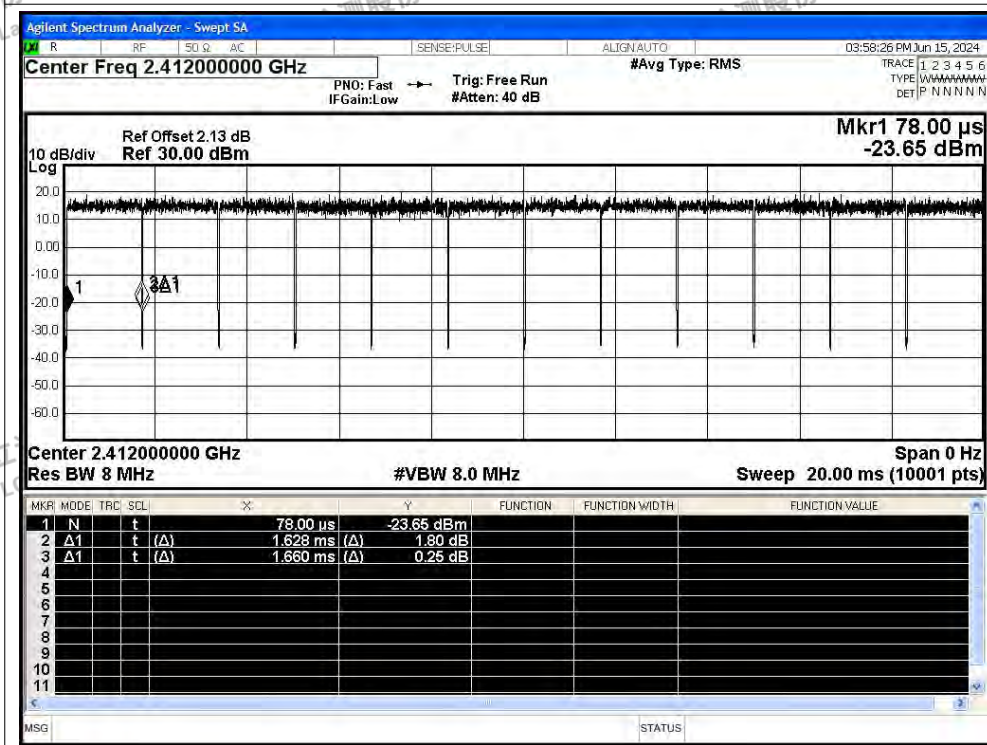

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT g 2437MHz Ant3

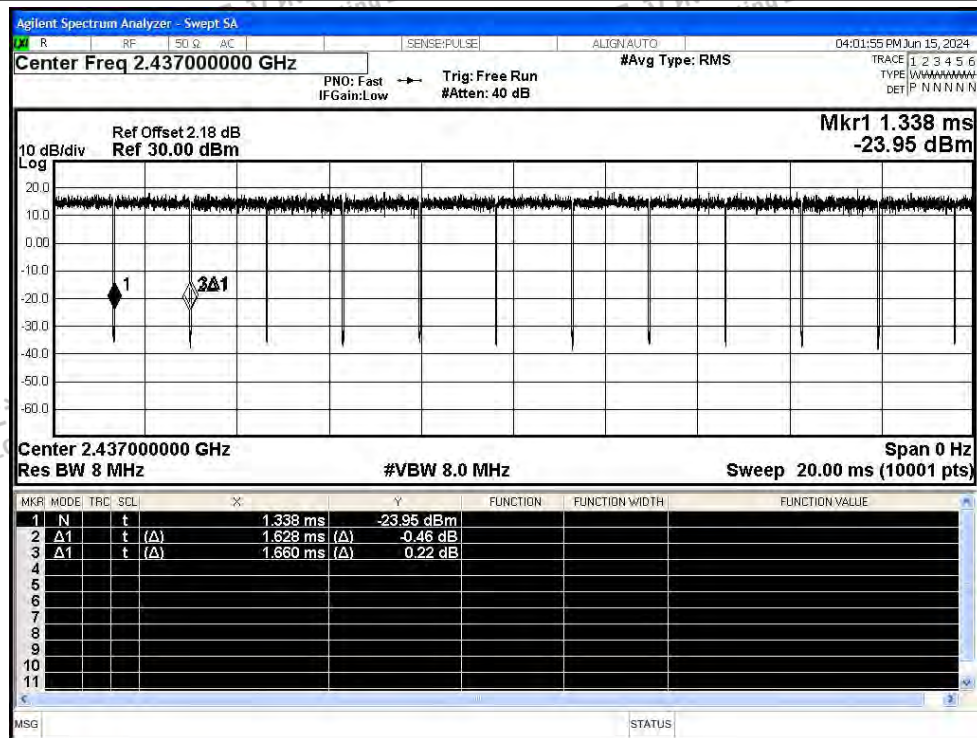

Duty Cycle NVNT g 2462MHz Ant3

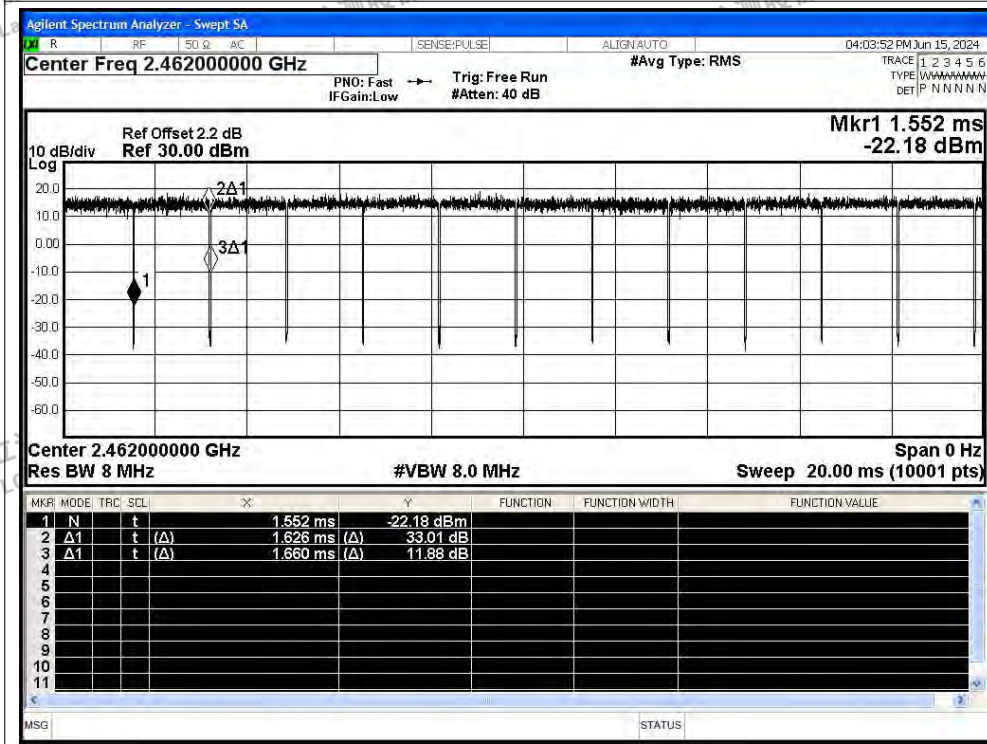

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 2412MHz Ant3

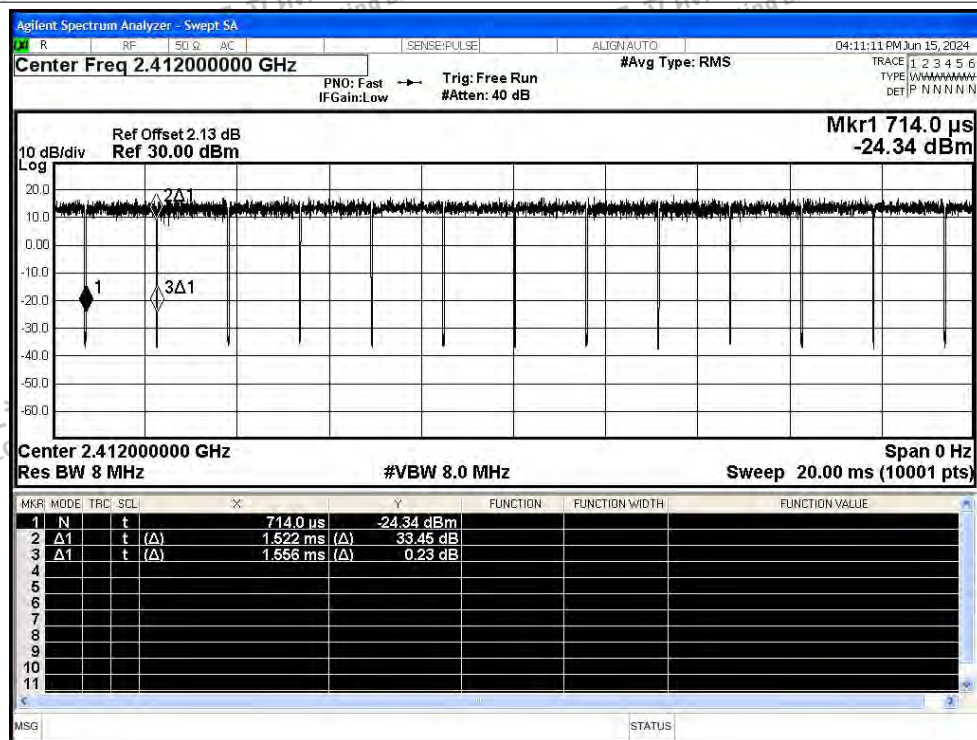

Duty Cycle NVNT n20 2437MHz Ant3

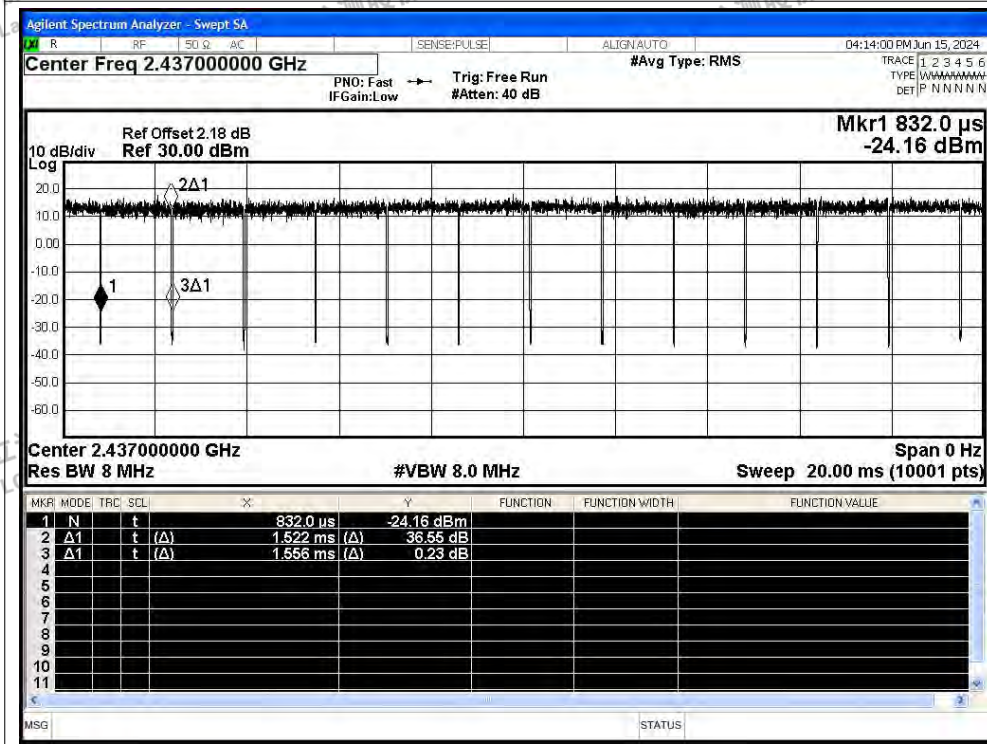

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 2462MHz Ant3

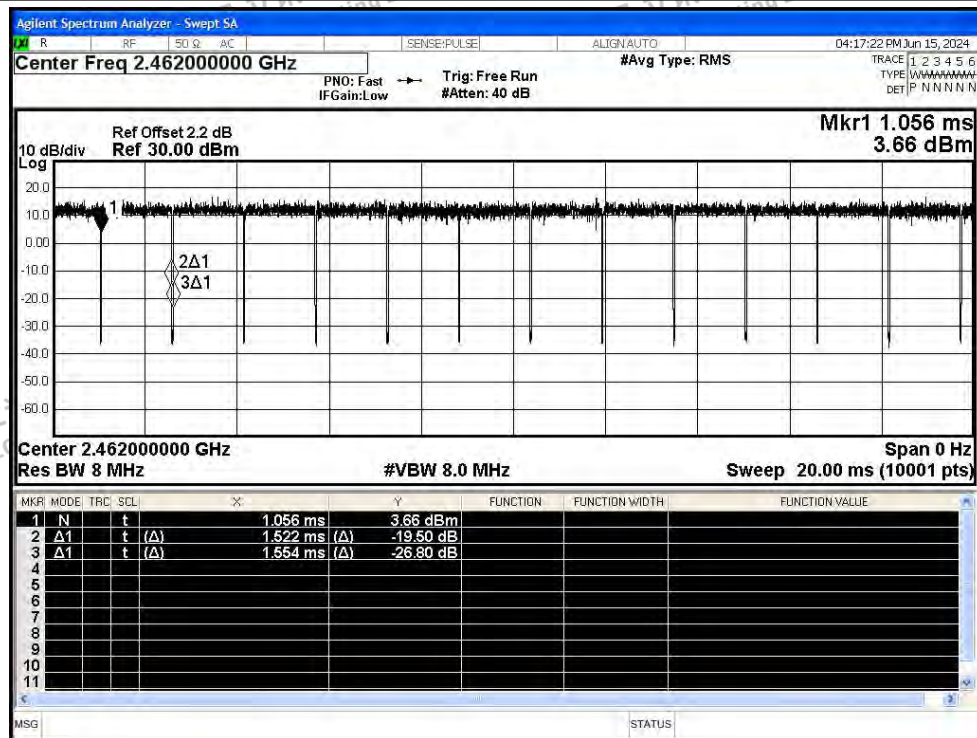


Duty Cycle NVNT n40 2422MHz Ant3

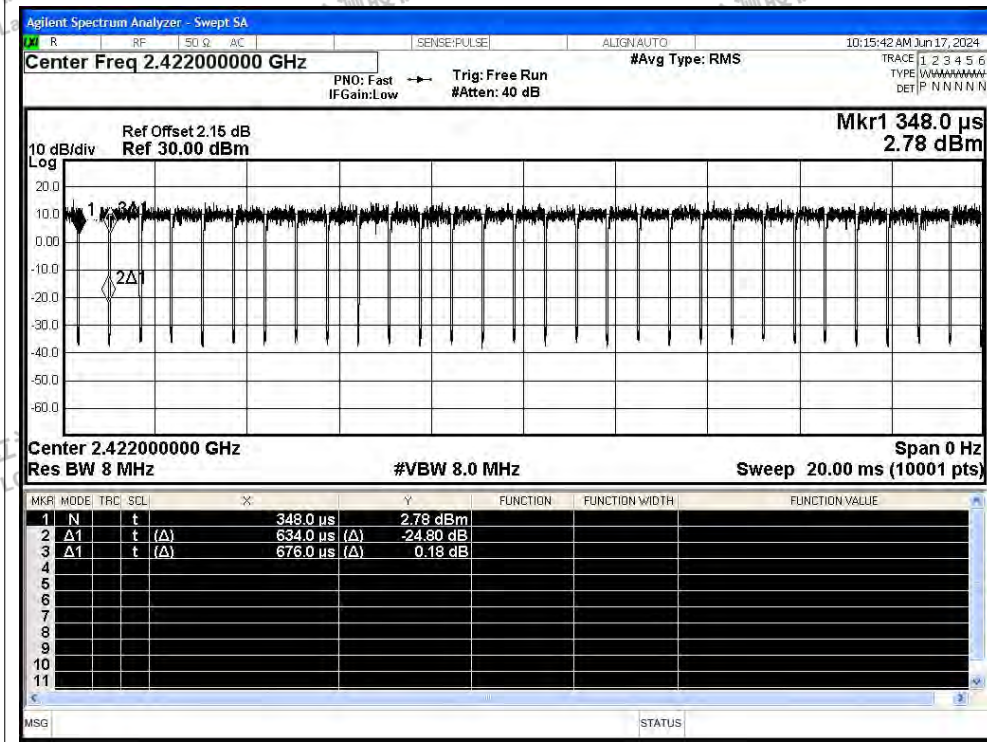




Duty Cycle NVNT n40 2437MHz Ant3

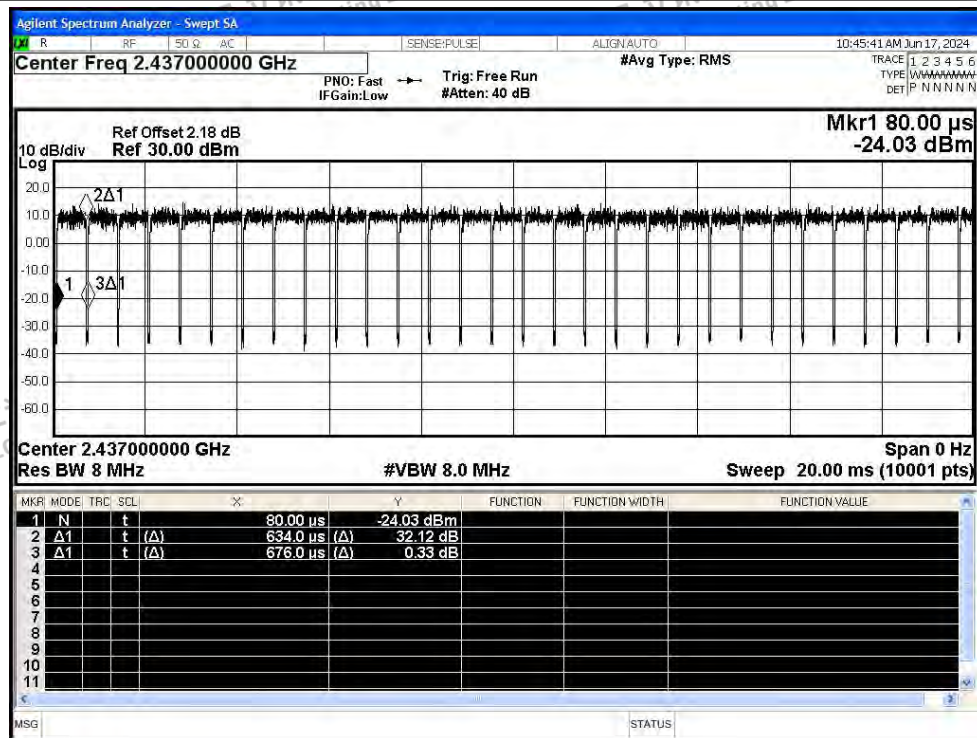

Duty Cycle NVNT n40 2452MHz Ant3

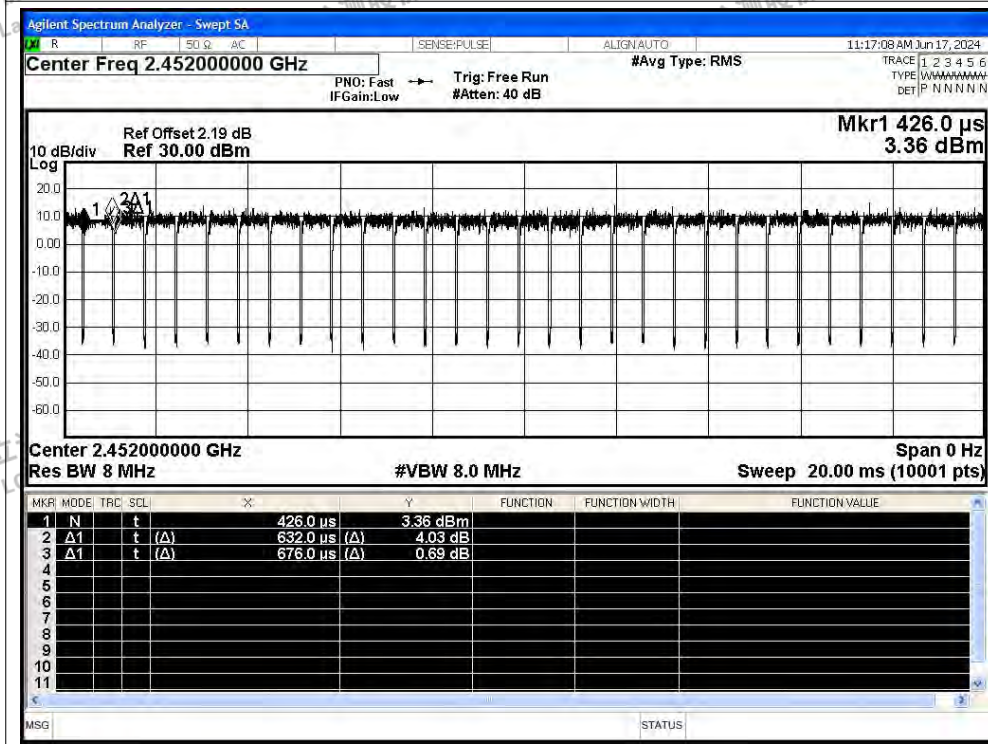

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 2412MHz Ant3

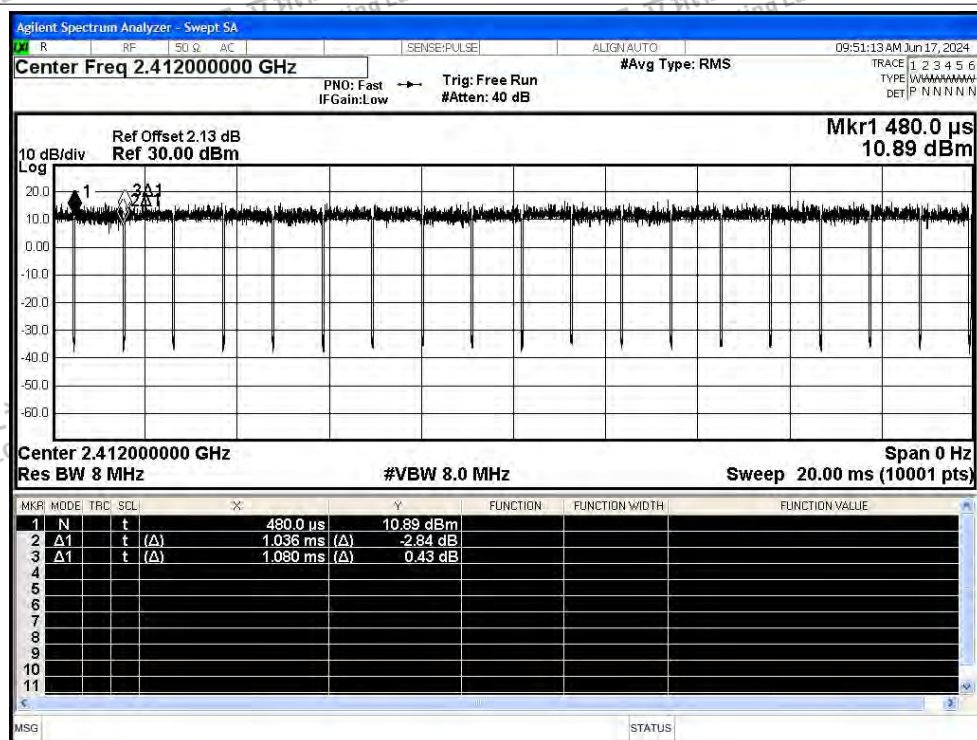

Duty Cycle NVNT ax20 2437MHz Ant3

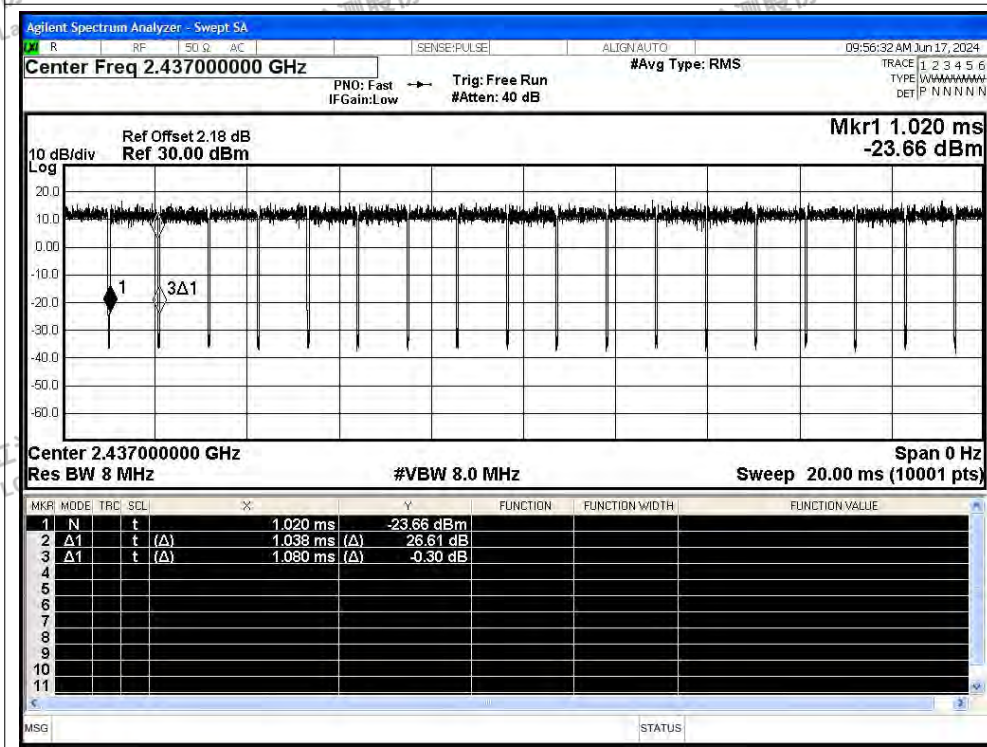

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 2462MHz Ant3

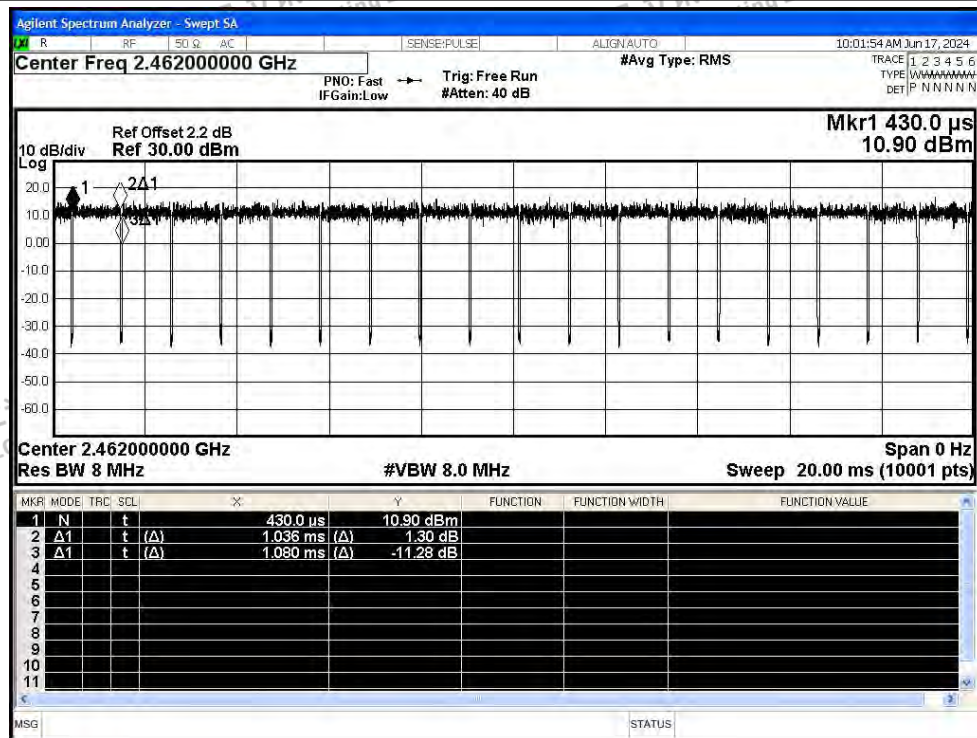


Duty Cycle NVNT ax40 2422MHz Ant3

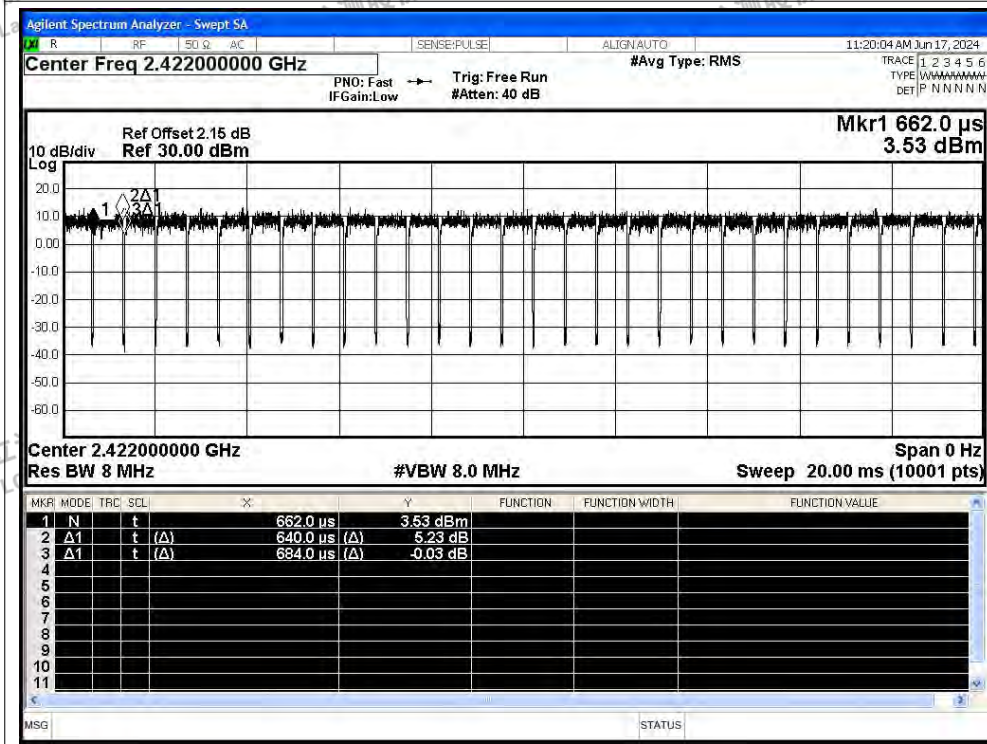




Duty Cycle NVNT ax40 2437MHz Ant3

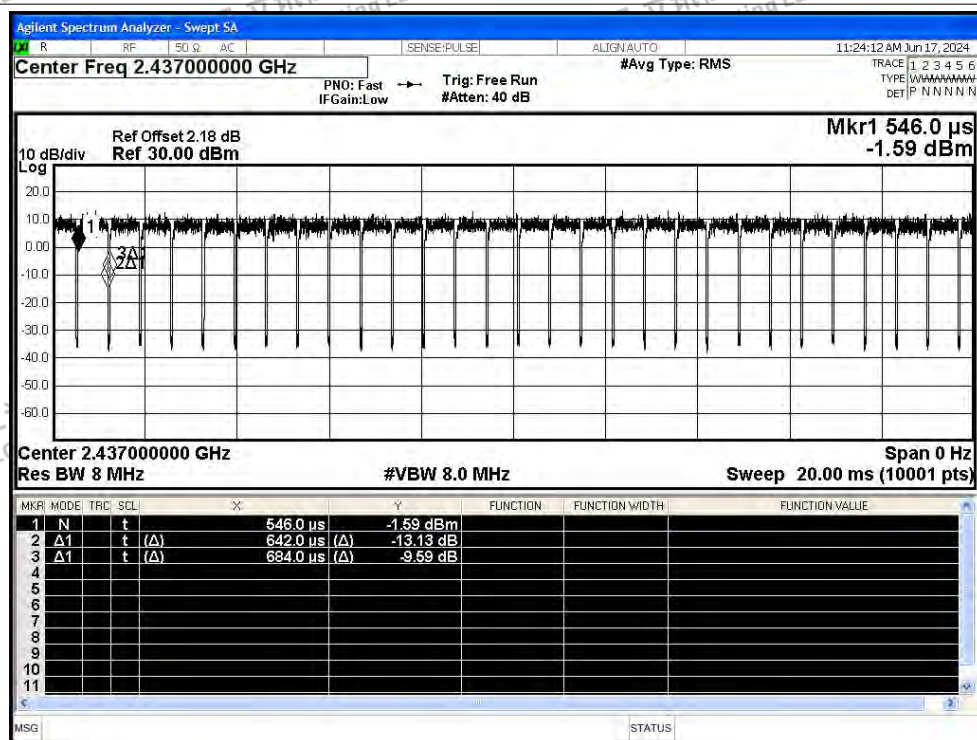

Duty Cycle NVNT ax40 2452MHz Ant3

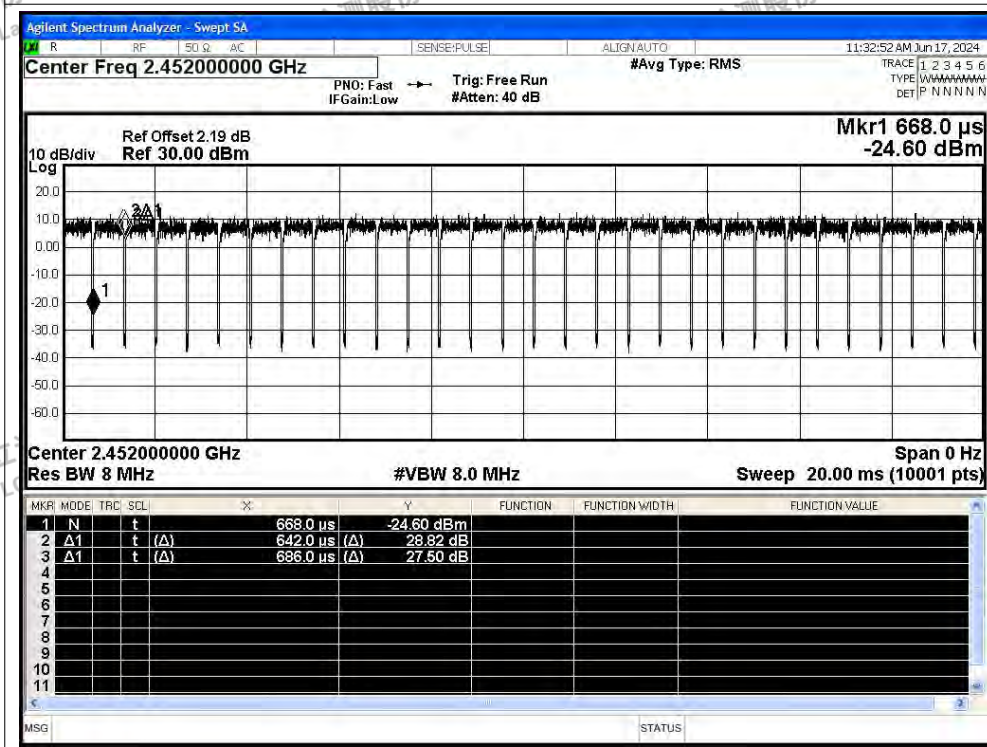

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	b	2412	Ant4	99.46	0	0.15
NVNT	b	2437	Ant4	99.46	0	0.15
NVNT	b	2462	Ant4	99.43	0	0.15
NVNT	g	2412	Ant4	96.3	0.16	0.91
NVNT	g	2437	Ant4	96.3	0.16	0.91
NVNT	g	2462	Ant4	96.3	0.16	0.91
NVNT	n20	2412	Ant4	96.66	0.15	0.78
NVNT	n20	2437	Ant4	96.81	0.14	0.78
NVNT	n20	2462	Ant4	96.66	0.15	0.79
NVNT	n40	2422	Ant4	94.72	0.24	1.33
NVNT	n40	2437	Ant4	94.49	0.25	1.33
NVNT	n40	2452	Ant4	94.47	0.25	1.33
NVNT	ax20	2412	Ant4	96.68	0.15	0.78
NVNT	ax20	2437	Ant4	96.83	0.14	0.78
NVNT	ax20	2462	Ant4	96.68	0.15	0.78
NVNT	ax40	2422	Ant4	94.5	0.25	1.32
NVNT	ax40	2437	Ant4	94.5	0.25	1.32
NVNT	ax40	2452	Ant4	94.5	0.25	1.32






Test Graphs

Duty Cycle NVNT b 2412MHz Ant4

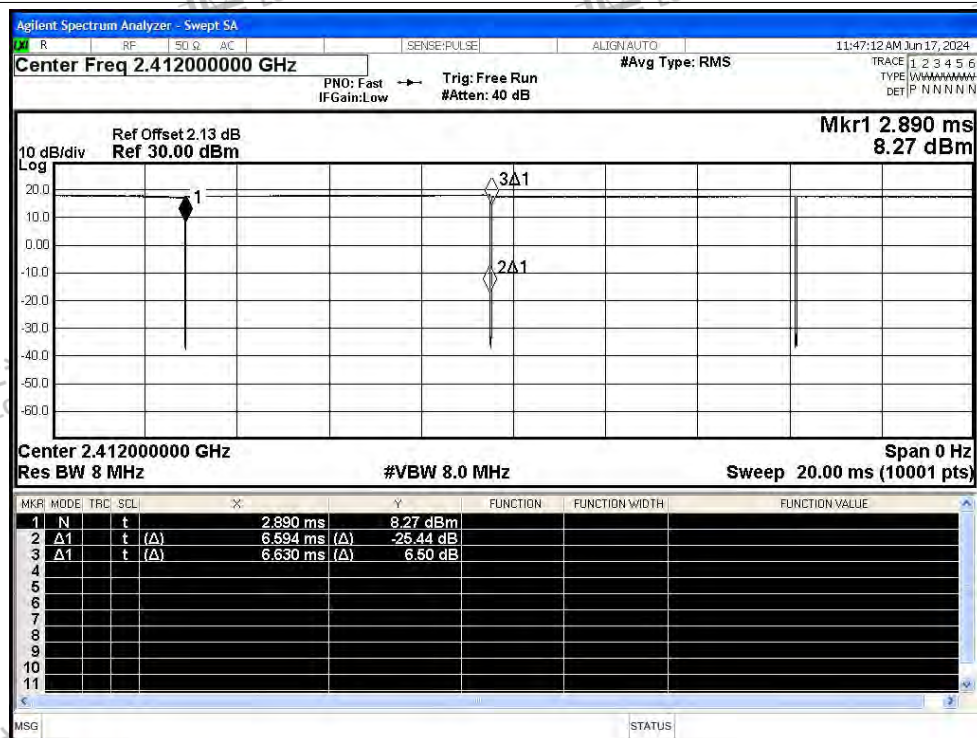

Duty Cycle NVNT b 2437MHz Ant4

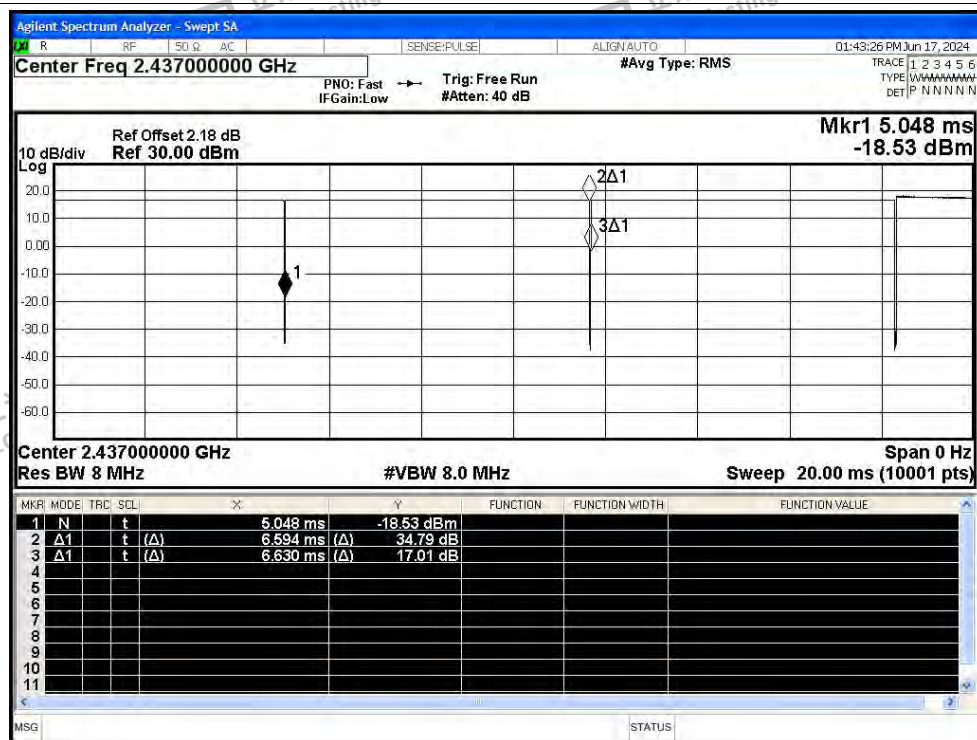

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT b 2462MHz Ant4

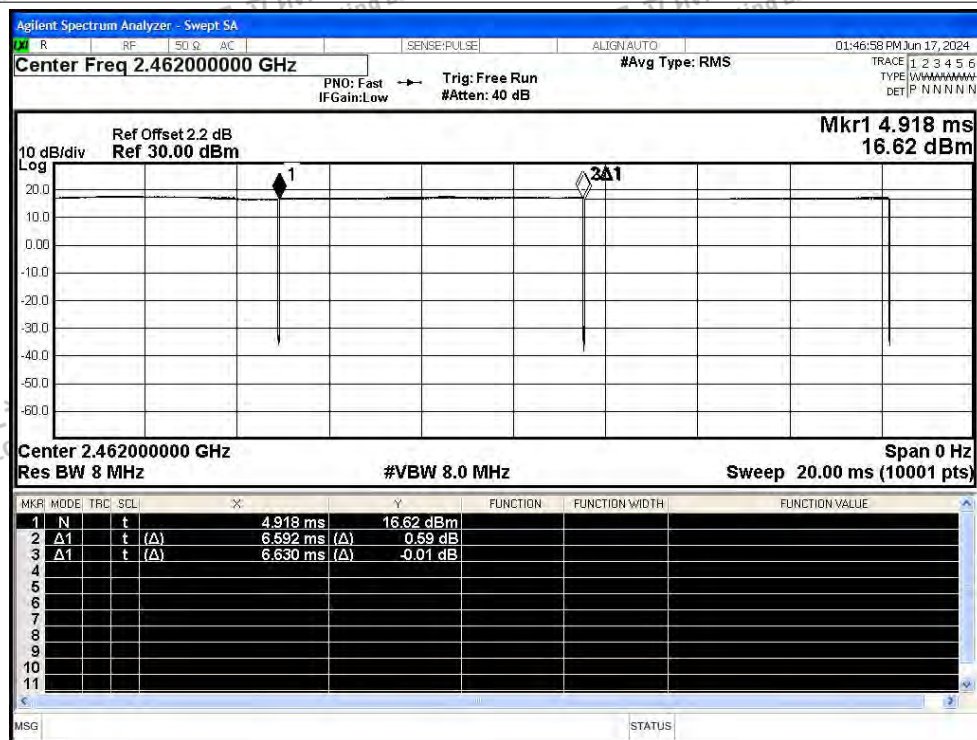

Duty Cycle NVNT g 2412MHz Ant4

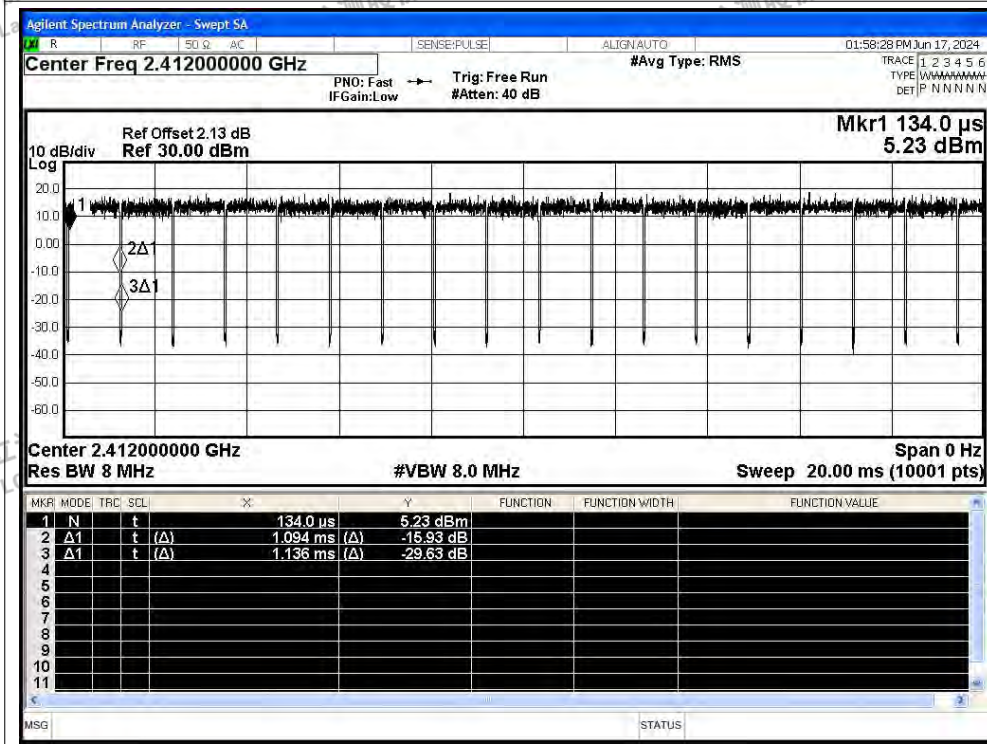

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT g 2437MHz Ant4

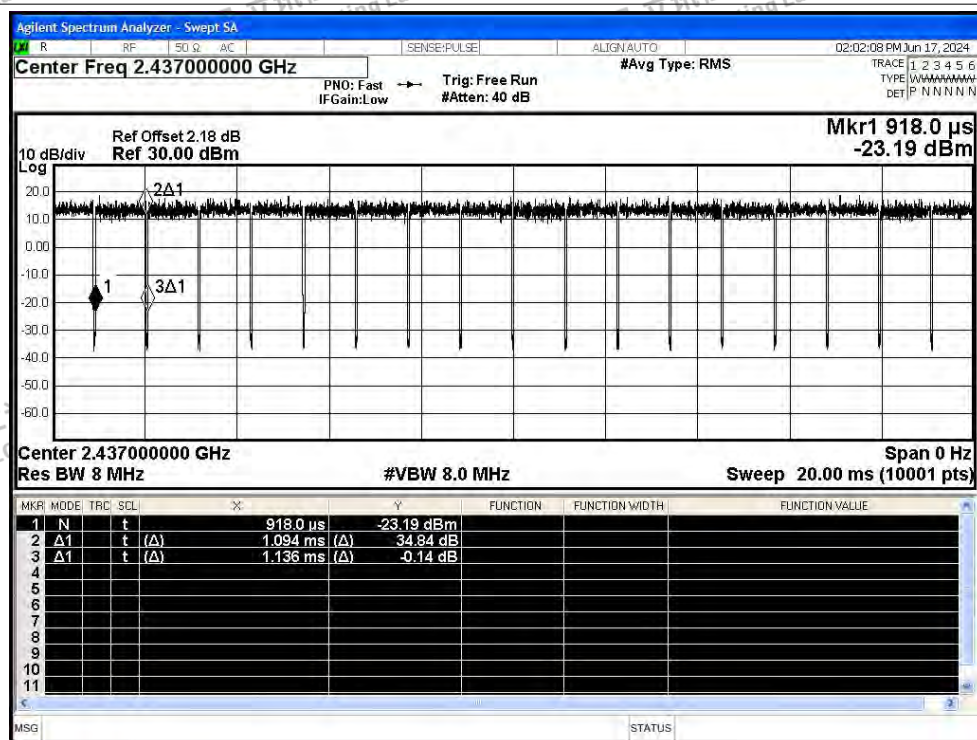

Duty Cycle NVNT g 2462MHz Ant4

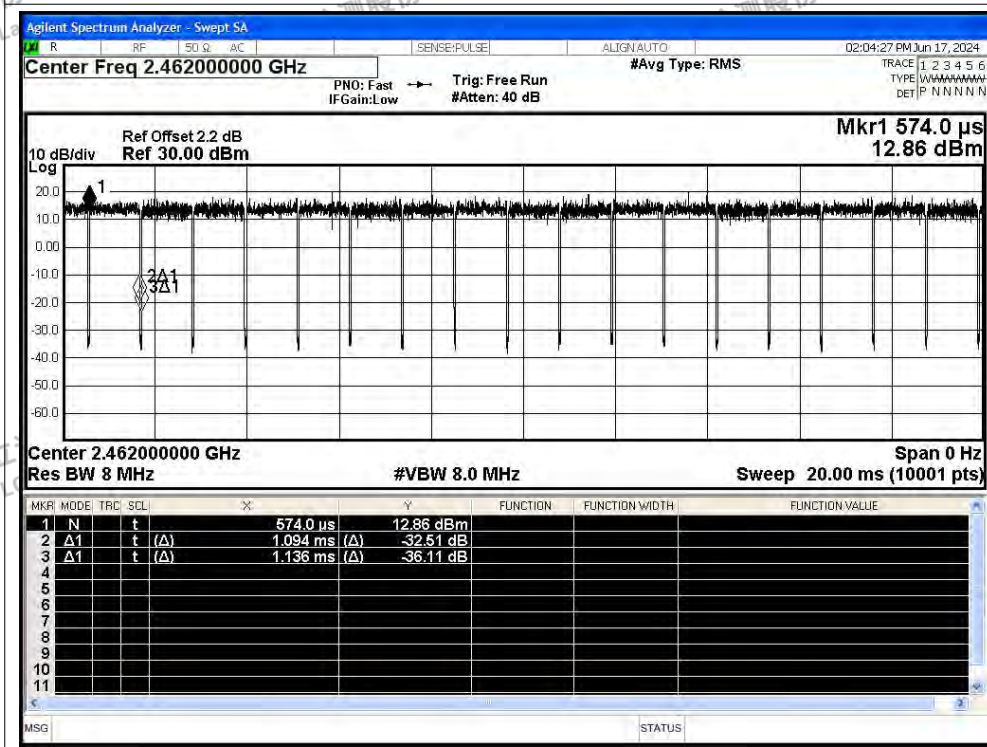

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 2412MHz Ant4

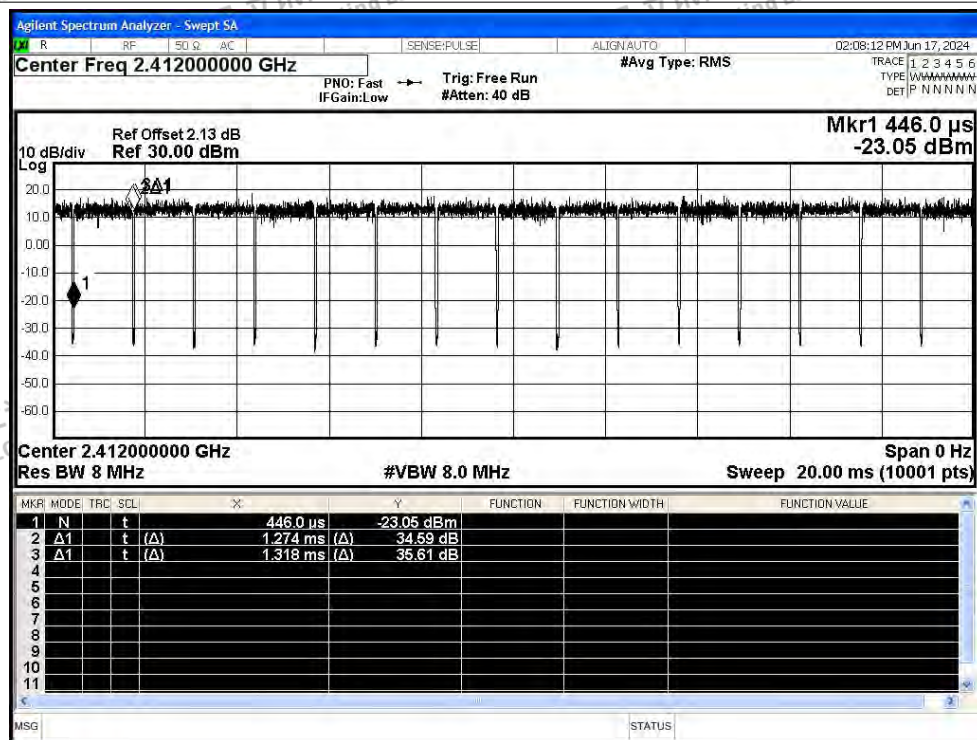

Duty Cycle NVNT n20 2437MHz Ant4

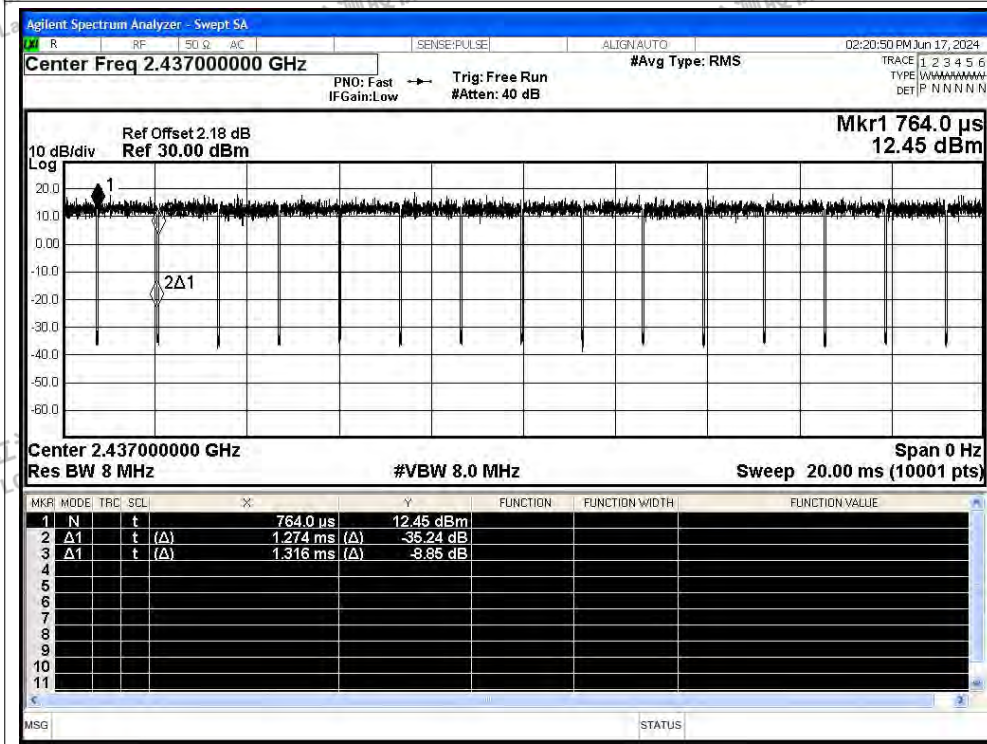

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Duty Cycle NVNT n20 2462MHz Ant4

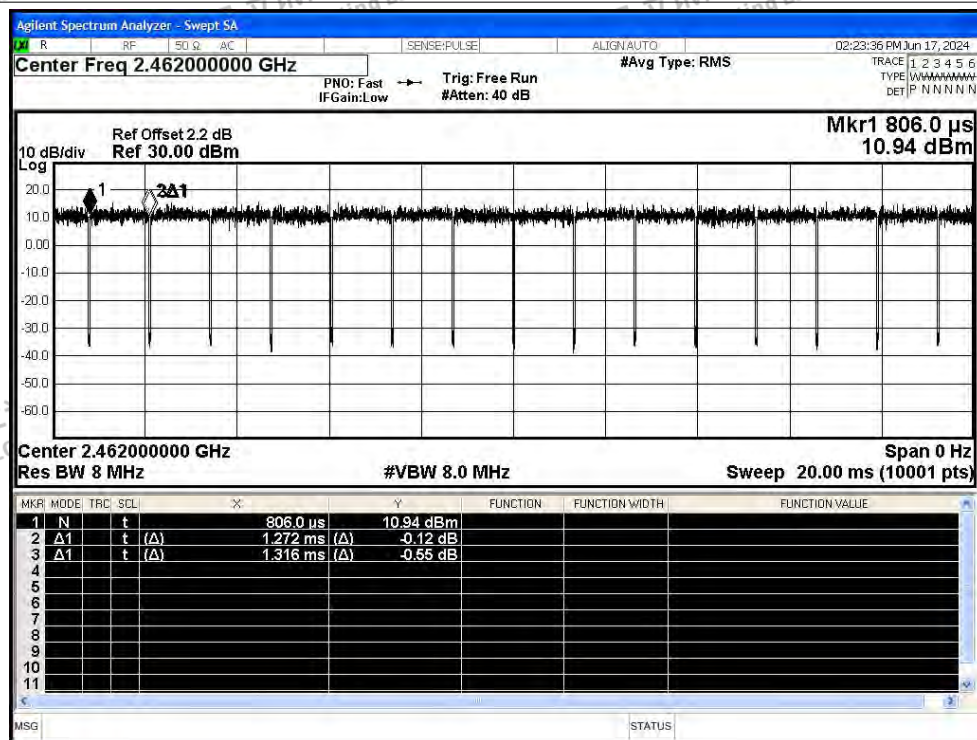

Duty Cycle NVNT n40 2422MHz Ant4

