





Restrict Band NVNT ac80 5210MHz Ant2 Peak

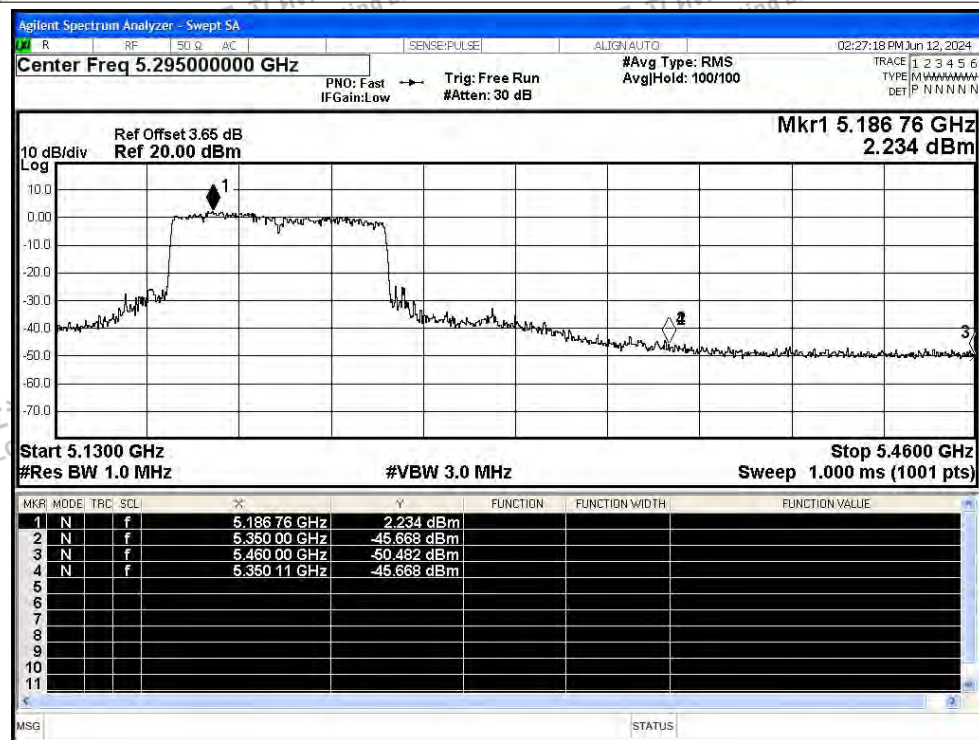

Restrict Band NVNT ac80 5210MHz Ant2 Average

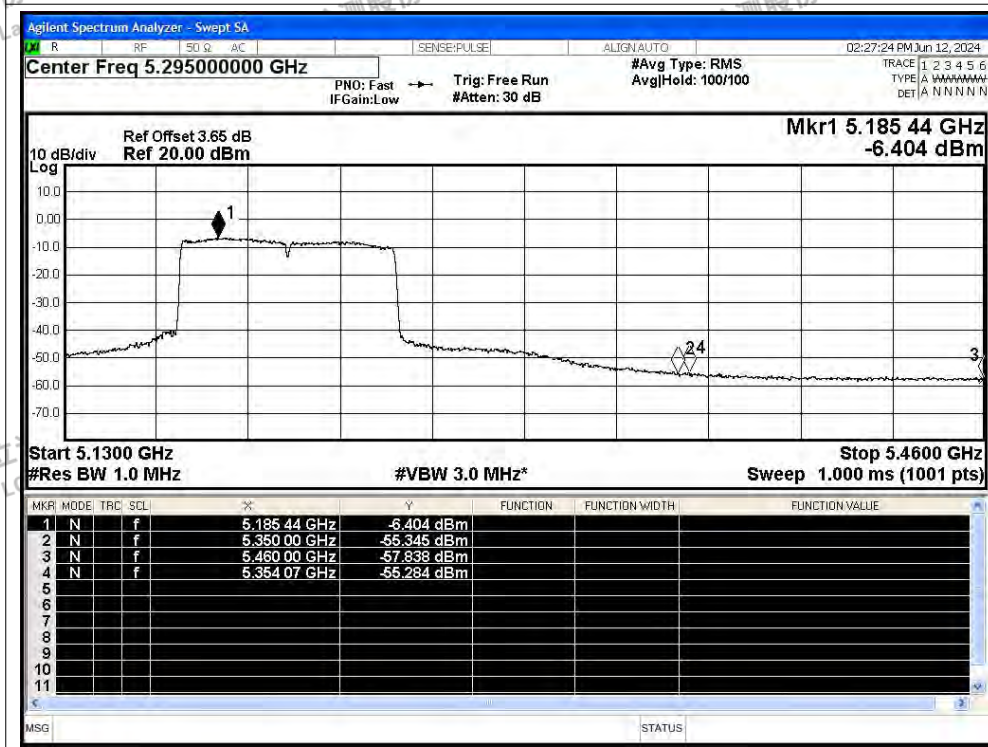

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

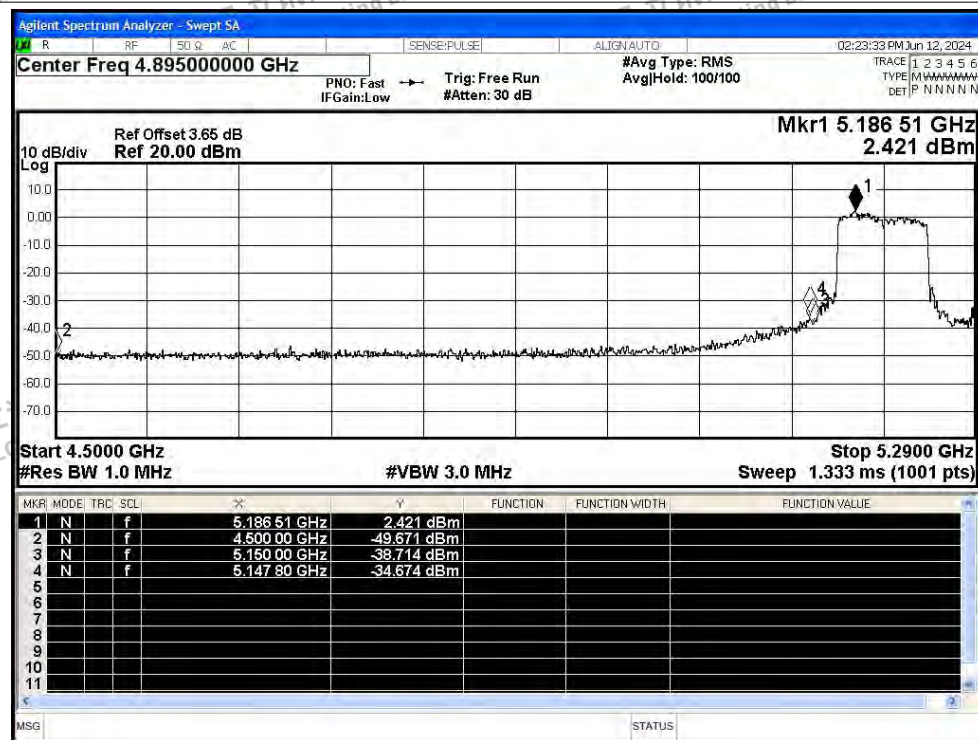

Restrict Band NVNT ac80 5210MHz Ant2 Average

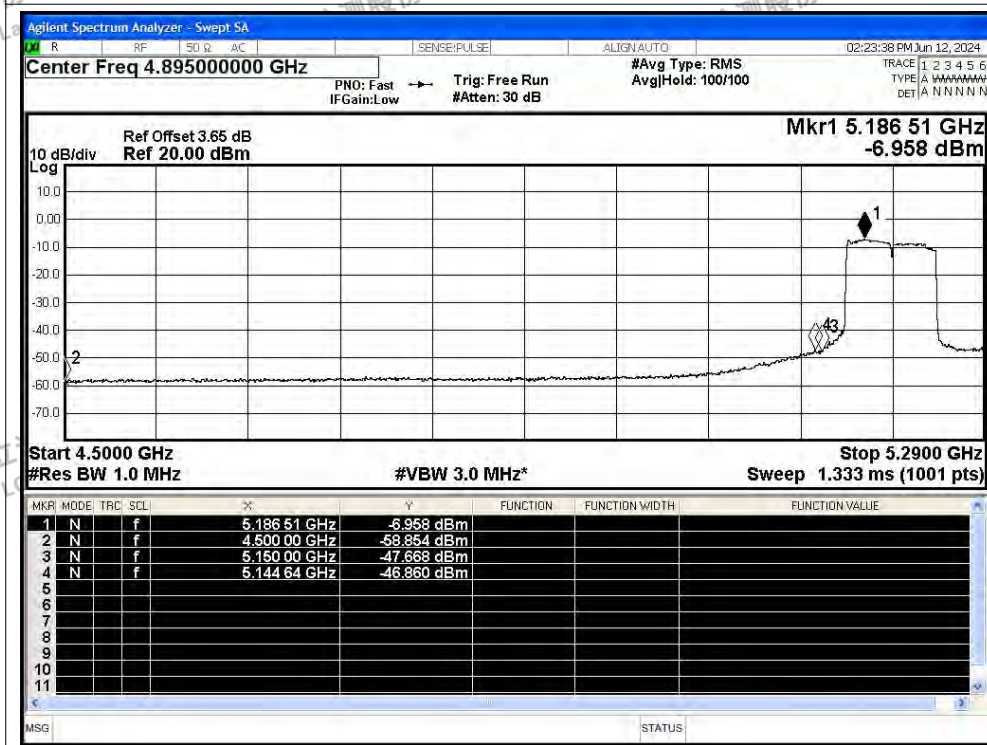

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant2 Peak

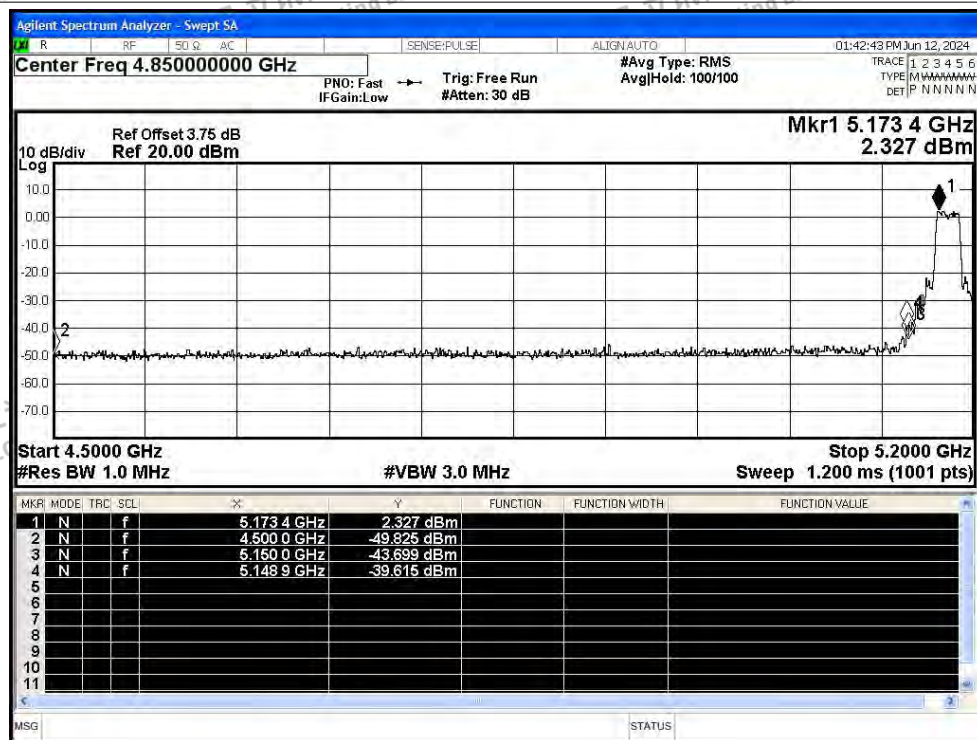

Restrict Band NVNT ax20 5180MHz Ant2 Average

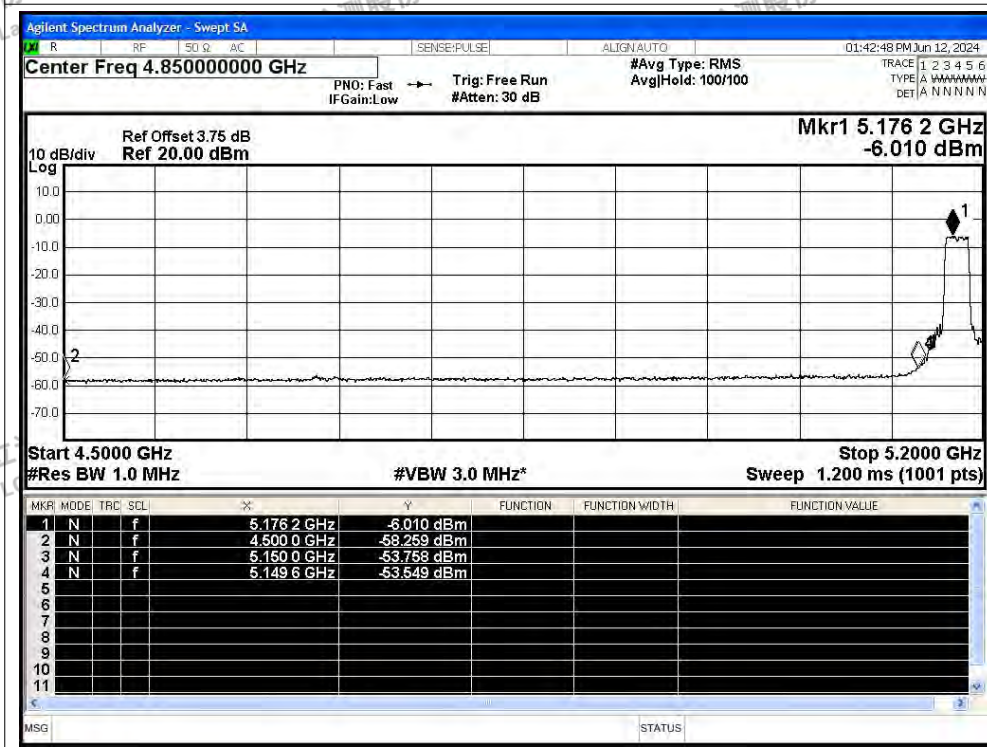

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant2 Peak

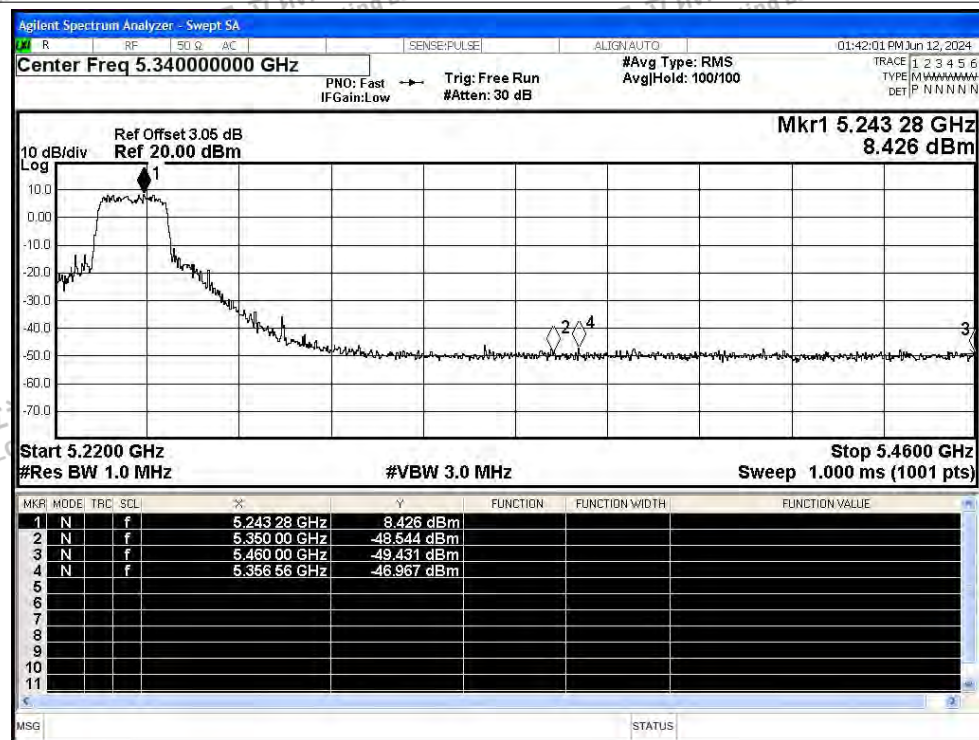

Restrict Band NVNT ax20 5240MHz Ant2 Average

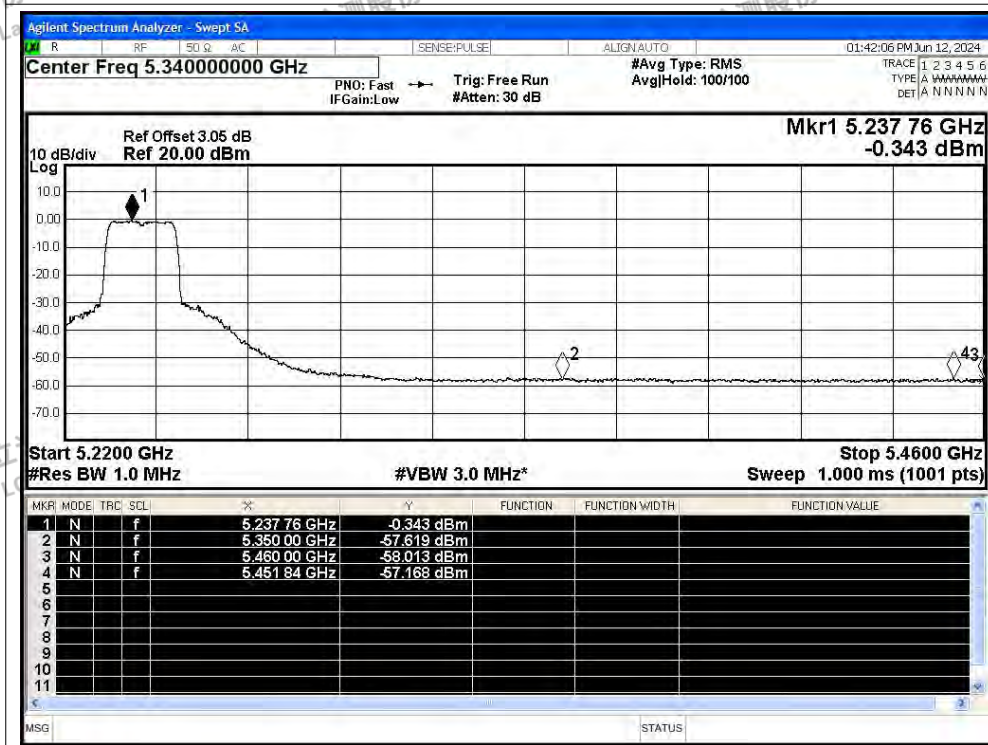

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant2 Peak

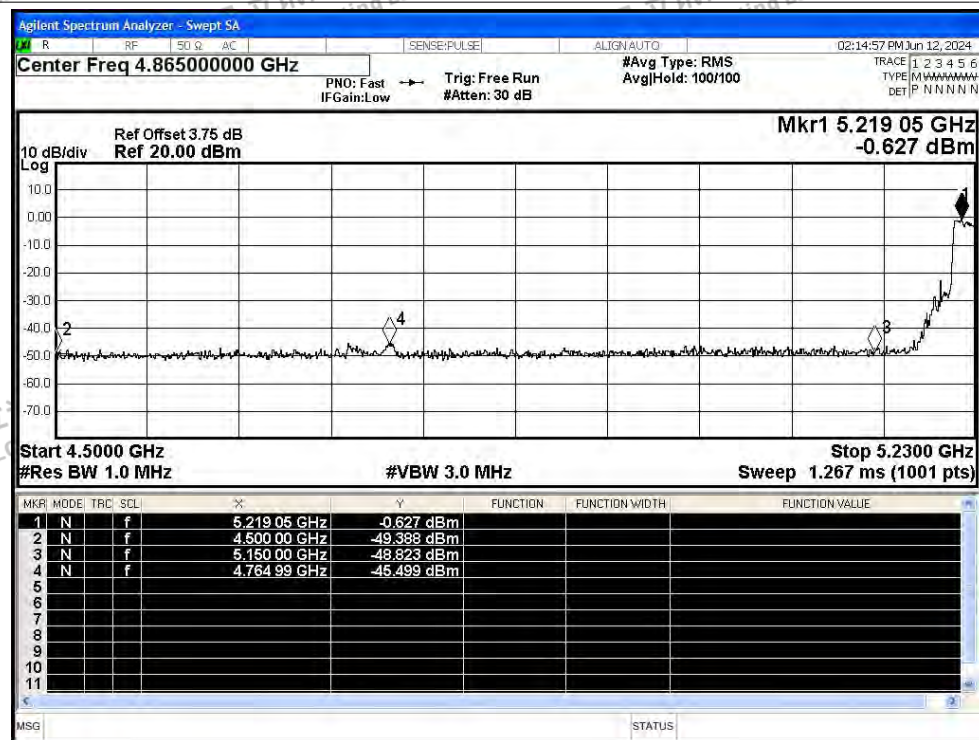

Restrict Band NVNT ax40 5190MHz Ant2 Average

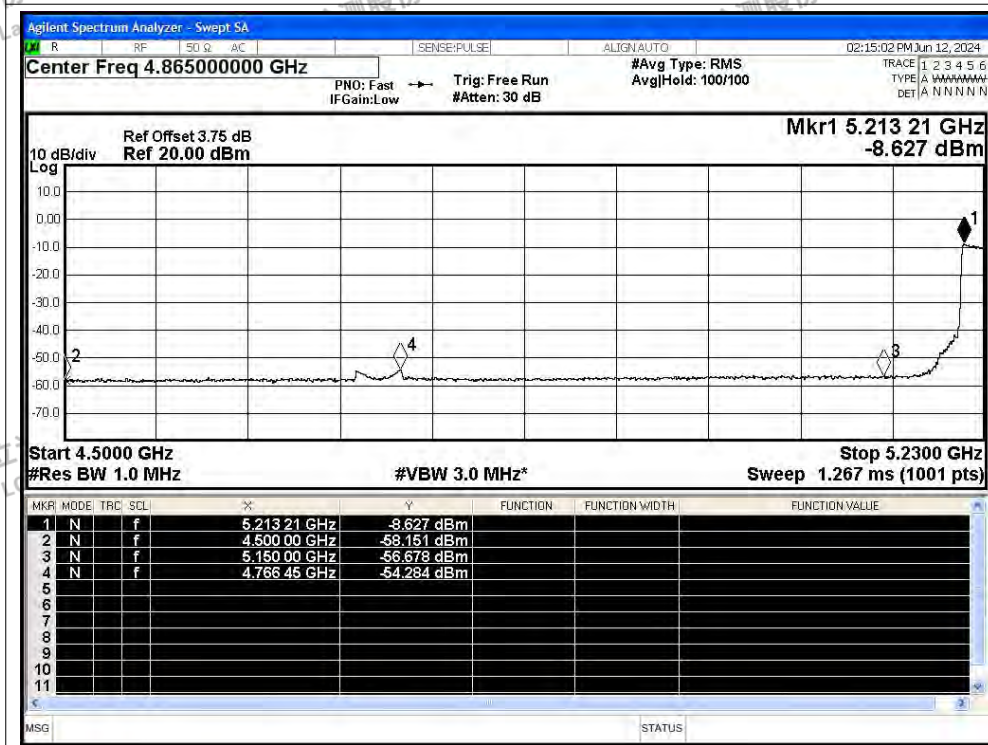

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant2 Peak

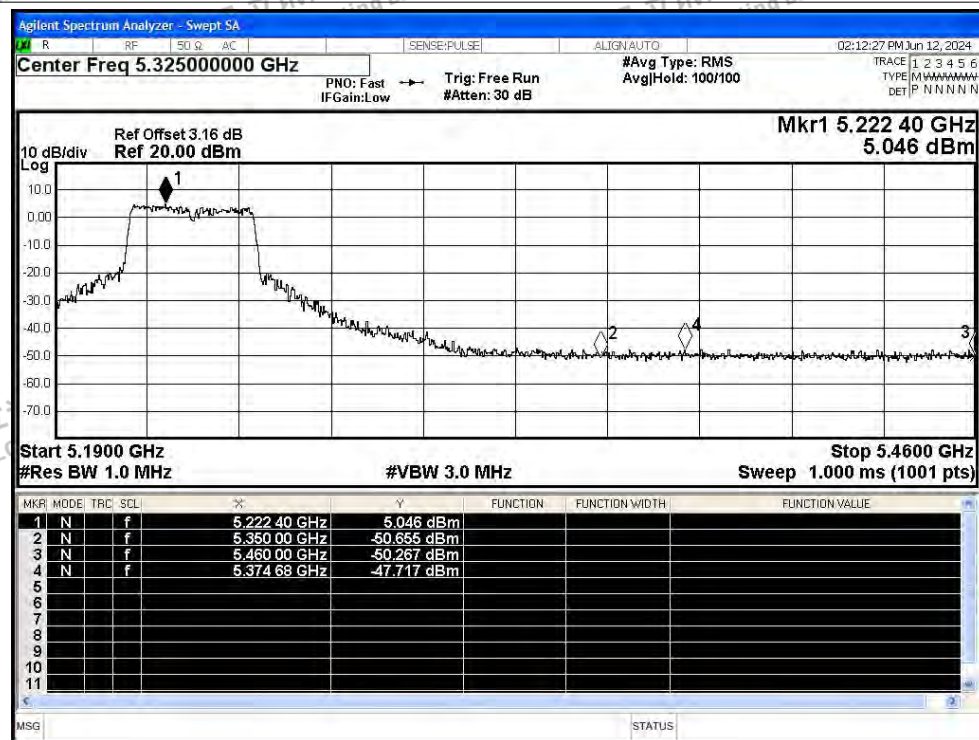

Restrict Band NVNT ax40 5230MHz Ant2 Average

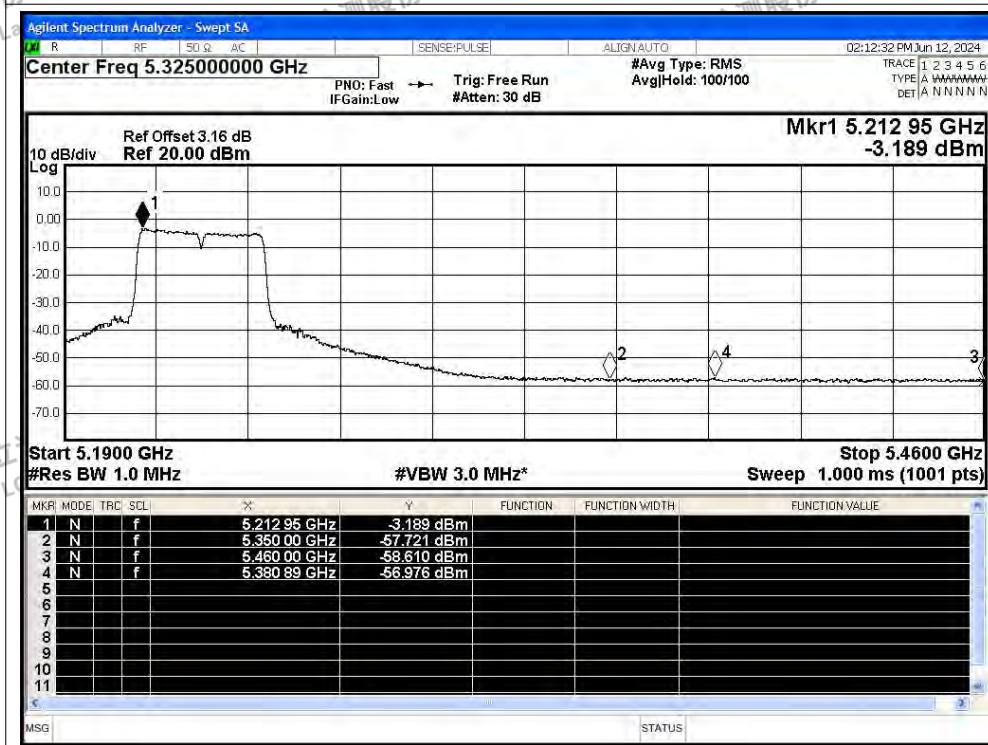

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

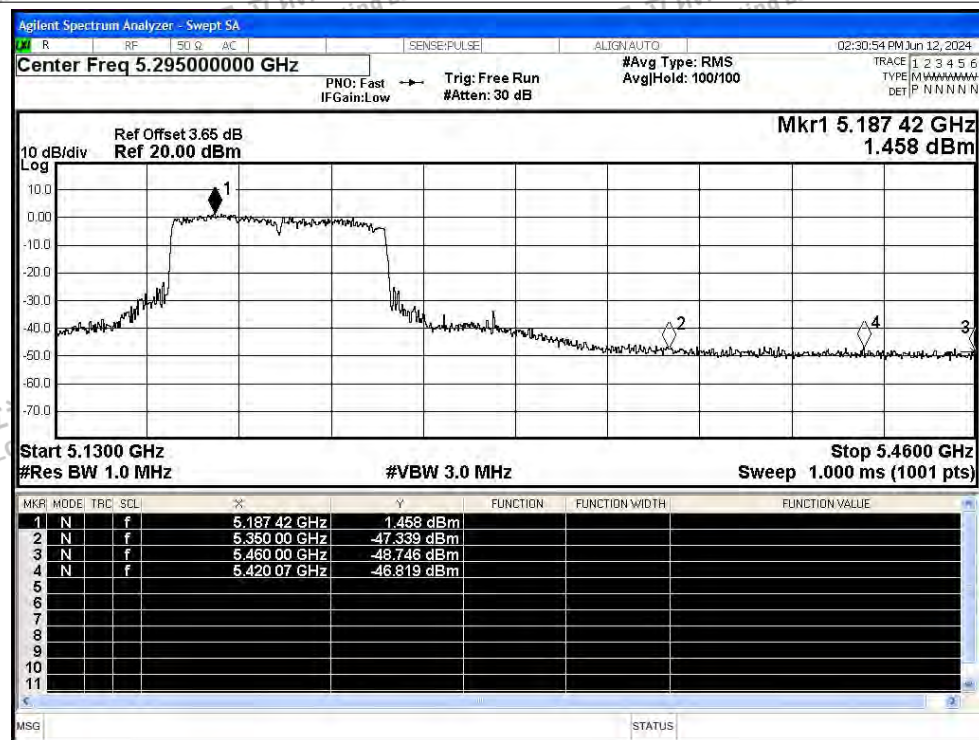

Restrict Band NVNT ax80 5210MHz Ant2 Average

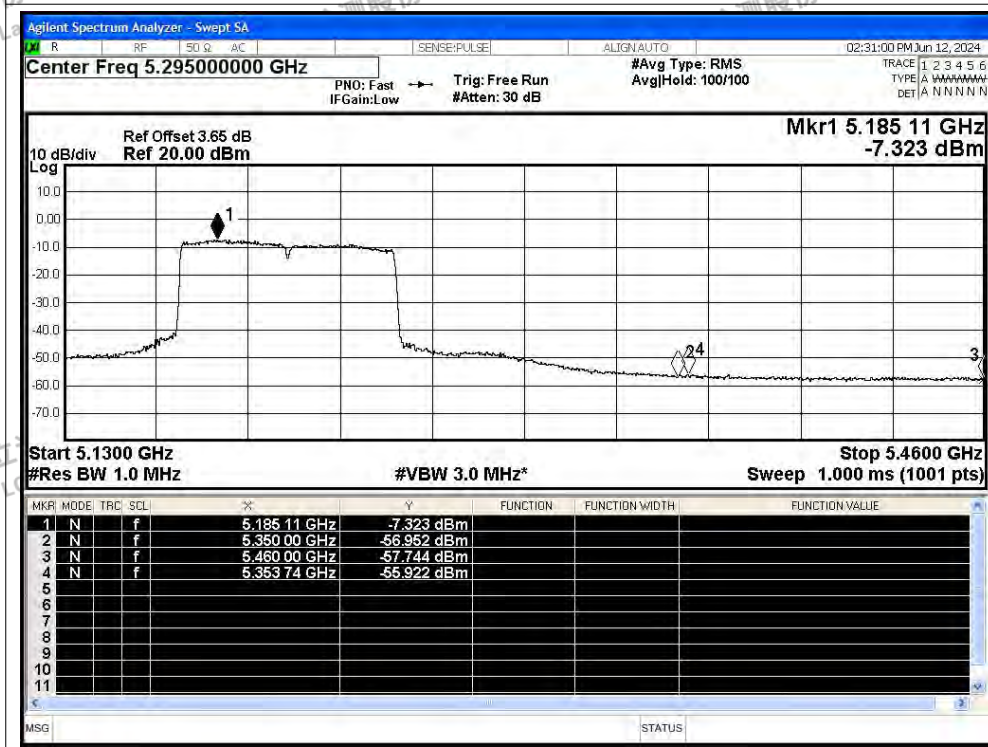

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant2 Peak

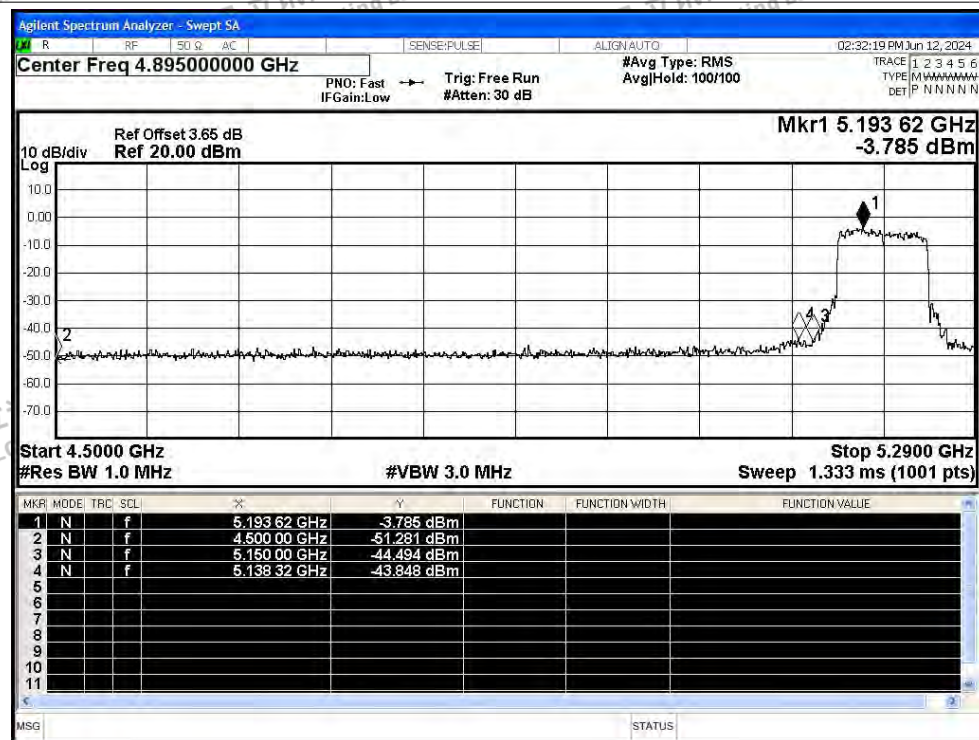

Restrict Band NVNT ax80 5210MHz Ant2 Average

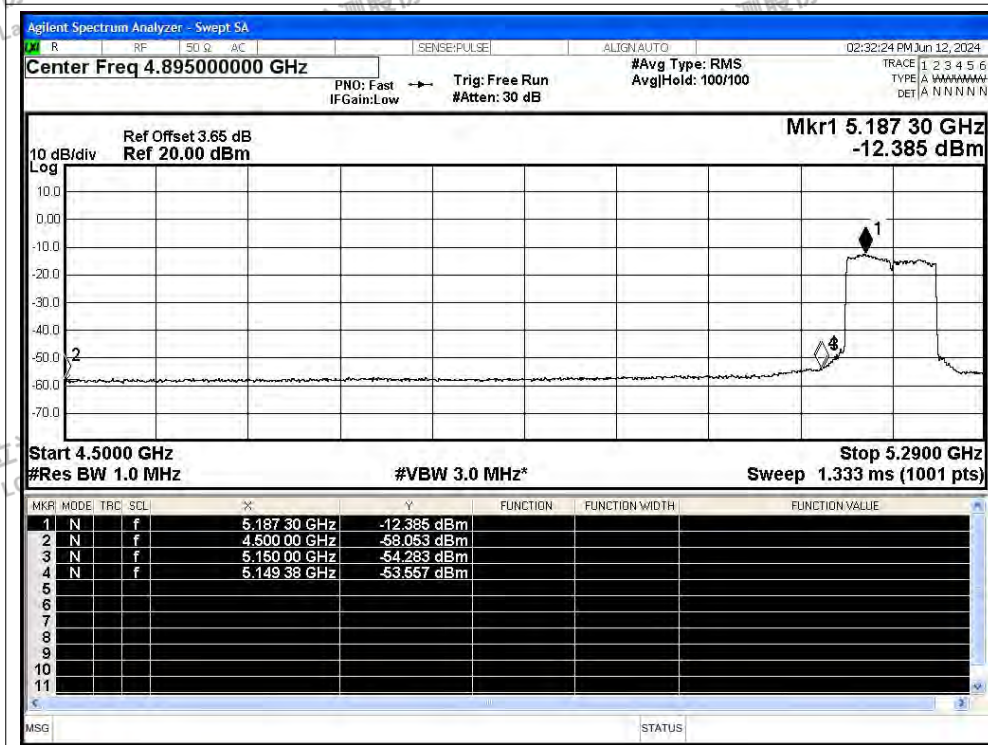

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant3	4500	-50.94	3.59	-	47.88	Peak	68.2	Pass
NVNT	a	5180	Ant3	4500	-58.15	3.59	0.24	40.91	Average	54	Pass
NVNT	a	5180	Ant3	5147.5	-44.16	3.59	-	54.66	Peak	68.2	Pass
NVNT	a	5180	Ant3	5149.6	-54.12	3.59	0.24	44.94	Average	54	Pass
NVNT	a	5180	Ant3	5150	-44.86	3.59	-	53.96	Peak	68.2	Pass
NVNT	a	5180	Ant3	5150	-53.65	3.59	0.24	45.41	Average	54	Pass
NVNT	a	5240	Ant3	5350	-49.95	3.59	-	48.87	Peak	68.2	Pass
NVNT	a	5240	Ant3	5350	-57.09	3.59	0.24	41.97	Average	54	Pass
NVNT	a	5240	Ant3	5361.12	-47.2	3.59	-	51.62	Peak	68.2	Pass
NVNT	a	5240	Ant3	5351.28	-56.83	3.59	0.24	42.23	Average	54	Pass
NVNT	a	5240	Ant3	5460	-50.38	3.59	-	48.44	Peak	68.2	Pass
NVNT	a	5240	Ant3	5460	-57.55	3.59	0.24	41.51	Average	54	Pass
NVNT	n20	5180	Ant3	4500	-48.98	3.59	-	49.84	Peak	68.2	Pass
NVNT	n20	5180	Ant3	4500	-58.4	3.59	0.28	40.70	Average	54	Pass
NVNT	n20	5180	Ant3	5147.5	-41.04	3.59	-	57.78	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5149.6	-53.16	3.59	0.28	45.94	Average	54	Pass
NVNT	n20	5180	Ant3	5150	-37.99	3.59	-	60.83	Peak	68.2	Pass
NVNT	n20	5180	Ant3	5150	-52.65	3.59	0.28	46.45	Average	54	Pass
NVNT	n20	5240	Ant3	5350	-48.83	3.59	-	49.99	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5350	-57.76	3.59	0.28	41.34	Average	54	Pass
NVNT	n20	5240	Ant3	5385.12	-47.23	3.59	-	51.59	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5352	-56.84	3.59	0.28	42.26	Average	54	Pass
NVNT	n20	5240	Ant3	5460	-50.62	3.59	-	48.20	Peak	68.2	Pass
NVNT	n20	5240	Ant3	5460	-57.97	3.59	0.28	41.13	Average	54	Pass
NVNT	n40	5190	Ant3	4500	-50.98	3.59	-	47.84	Peak	68.2	Pass
NVNT	n40	5190	Ant3	4500	-58.84	3.59	0.12	40.10	Average	54	Pass
NVNT	n40	5190	Ant3	5146.05	-37.32	3.59	-	61.50	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5149.7	-54.48	3.59	0.12	44.46	Average	54	Pass
NVNT	n40	5190	Ant3	5150	-40.57	3.59	-	58.25	Peak	68.2	Pass
NVNT	n40	5190	Ant3	5150	-54.48	3.59	0.12	44.46	Average	54	Pass
NVNT	n40	5230	Ant3	5350	-49.87	3.59	-	48.95	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5350	-57.36	3.59	0.12	41.58	Average	54	Pass
NVNT	n40	5230	Ant3	5350.92	-46.89	3.59	-	51.93	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5366.58	-56.91	3.59	0.12	42.03	Average	54	Pass
NVNT	n40	5230	Ant3	5460	-51.12	3.59	-	47.70	Peak	68.2	Pass
NVNT	n40	5230	Ant3	5460	-58.24	3.59	0.12	40.70	Average	54	Pass
NVNT	ac20	5180	Ant3	4500	-50.05	3.59	-	48.77	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant3	4500	-58.47	3.59	0.28	40.63	Average	54	Pass
NVNT	ac20	5180	Ant3	5149.6	-39.75	3.59	-	59.07	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5149.6	-52.39	3.59	0.28	46.71	Average	54	Pass
NVNT	ac20	5180	Ant3	5150	-43.31	3.59	-	55.51	Peak	68.2	Pass
NVNT	ac20	5180	Ant3	5150	-51.3	3.59	0.28	47.80	Average	54	Pass
NVNT	ac20	5240	Ant3	5350	-49.61	3.59	-	49.21	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350	-57.61	3.59	0.28	41.49	Average	54	Pass
NVNT	ac20	5240	Ant3	5444.88	-47.2	3.59	-	51.62	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5350.8	-57.11	3.59	0.28	41.99	Average	54	Pass
NVNT	ac20	5240	Ant3	5460	-48.72	3.59	-	50.10	Peak	68.2	Pass
NVNT	ac20	5240	Ant3	5460	-58.03	3.59	0.28	41.07	Average	54	Pass
NVNT	ac40	5190	Ant3	4500	-49.88	3.59	-	48.94	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	4500	-58.31	3.59	0.12	40.63	Average	54	Pass
NVNT	ac40	5190	Ant3	5147.51	-42.06	3.59	-	56.76	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5149.7	-54.63	3.59	0.12	44.31	Average	54	Pass
NVNT	ac40	5190	Ant3	5150	-46.55	3.59	-	52.27	Peak	68.2	Pass
NVNT	ac40	5190	Ant3	5150	-54.63	3.59	0.12	44.31	Average	54	Pass
NVNT	ac40	5230	Ant3	5350	-49.15	3.59	-	49.67	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5350	-57.84	3.59	0.12	41.10	Average	54	Pass
NVNT	ac40	5230	Ant3	5443.26	-47.25	3.59	-	51.57	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5372.52	-57.09	3.59	0.12	41.85	Average	54	Pass
NVNT	ac40	5230	Ant3	5460	-50.27	3.59	-	48.55	Peak	68.2	Pass
NVNT	ac40	5230	Ant3	5460	-58.28	3.59	0.12	40.66	Average	54	Pass
NVNT	ac80	5210	Ant3	5350	-48.24	3.59	-	50.58	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5350	-56.68	3.59	0.25	42.39	Average	54	Pass
NVNT	ac80	5210	Ant3	5350.44	-46.59	3.59	-	52.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5352.75	-56.41	3.59	0.25	42.66	Average	54	Pass
NVNT	ac80	5210	Ant3	5460	-50.46	3.59	-	48.36	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5460	-57.67	3.59	0.25	41.40	Average	54	Pass
NVNT	ac80	5210	Ant3	4500	-49.52	3.59	-	49.30	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	4500	-58.3	3.59	0.25	40.77	Average	54	Pass
NVNT	ac80	5210	Ant3	5149.38	-37.93	3.59	-	60.89	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5149.38	-52.64	3.59	0.25	46.43	Average	54	Pass
NVNT	ac80	5210	Ant3	5150	-43.55	3.59	-	55.27	Peak	68.2	Pass
NVNT	ac80	5210	Ant3	5150	-52.65	3.59	0.25	46.42	Average	54	Pass
NVNT	ax20	5180	Ant3	4500	-51.72	3.59	-	47.10	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	4500	-58.5	3.59	0.28	40.60	Average	54	Pass
NVNT	ax20	5180	Ant3	5144	-40.34	3.59	-	58.48	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5149.6	-52.2	3.59	0.28	46.90	Average	54	Pass
NVNT	ax20	5180	Ant3	5150	-41.56	3.59	-	57.26	Peak	68.2	Pass
NVNT	ax20	5180	Ant3	5150	-52.13	3.59	0.28	46.97	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant3	5350	-48.86	3.59	-	49.96	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5350	-57.8	3.59	0.28	41.30	Average	54	Pass
NVNT	ax20	5240	Ant3	5424	-47.18	3.59	-	51.64	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5352.24	-57.06	3.59	0.28	42.04	Average	54	Pass
NVNT	ax20	5240	Ant3	5460	-48.62	3.59	-	50.20	Peak	68.2	Pass
NVNT	ax20	5240	Ant3	5460	-58.08	3.59	0.28	41.02	Average	54	Pass
NVNT	ax40	5190	Ant3	4500	-52.42	3.59	-	46.40	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	4500	-58.71	3.59	0.12	40.23	Average	54	Pass
NVNT	ax40	5190	Ant3	5146.05	-34.93	3.59	-	63.89	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5149.7	-50.67	3.59	0.12	48.27	Average	54	Pass
NVNT	ax40	5190	Ant3	5150	-37.13	3.59	-	61.69	Peak	68.2	Pass
NVNT	ax40	5190	Ant3	5150	-50.67	3.59	0.12	48.27	Average	54	Pass
NVNT	ax40	5230	Ant3	5350	-49.64	3.59	-	49.18	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350	-57.36	3.59	0.12	41.58	Average	54	Pass
NVNT	ax40	5230	Ant3	5359.83	-47.09	3.59	-	51.73	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5350.38	-57.01	3.59	0.12	41.93	Average	54	Pass
NVNT	ax40	5230	Ant3	5460	-49.02	3.59	-	49.80	Peak	68.2	Pass
NVNT	ax40	5230	Ant3	5460	-58.04	3.59	0.12	40.90	Average	54	Pass
NVNT	ax80	5210	Ant3	5350	-49.05	3.59	-	49.77	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5350	-56.78	3.59	0.25	42.29	Average	54	Pass
NVNT	ax80	5210	Ant3	5351.1	-46.77	3.59	-	52.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5366.94	-56.2	3.59	0.25	42.87	Average	54	Pass
NVNT	ax80	5210	Ant3	5460	-48.59	3.59	-	50.23	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5460	-57.77	3.59	0.25	41.30	Average	54	Pass
NVNT	ax80	5210	Ant3	4500	-50	3.59	-	48.82	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	4500	-58.47	3.59	0.25	40.60	Average	54	Pass
NVNT	ax80	5210	Ant3	5147.8	-38.53	3.59	-	60.29	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5147.01	-52.63	3.59	0.25	46.44	Average	54	Pass
NVNT	ax80	5210	Ant3	5150	-43.43	3.59	-	55.39	Peak	68.2	Pass
NVNT	ax80	5210	Ant3	5150	-52.4	3.59	0.25	46.67	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant3 Peak

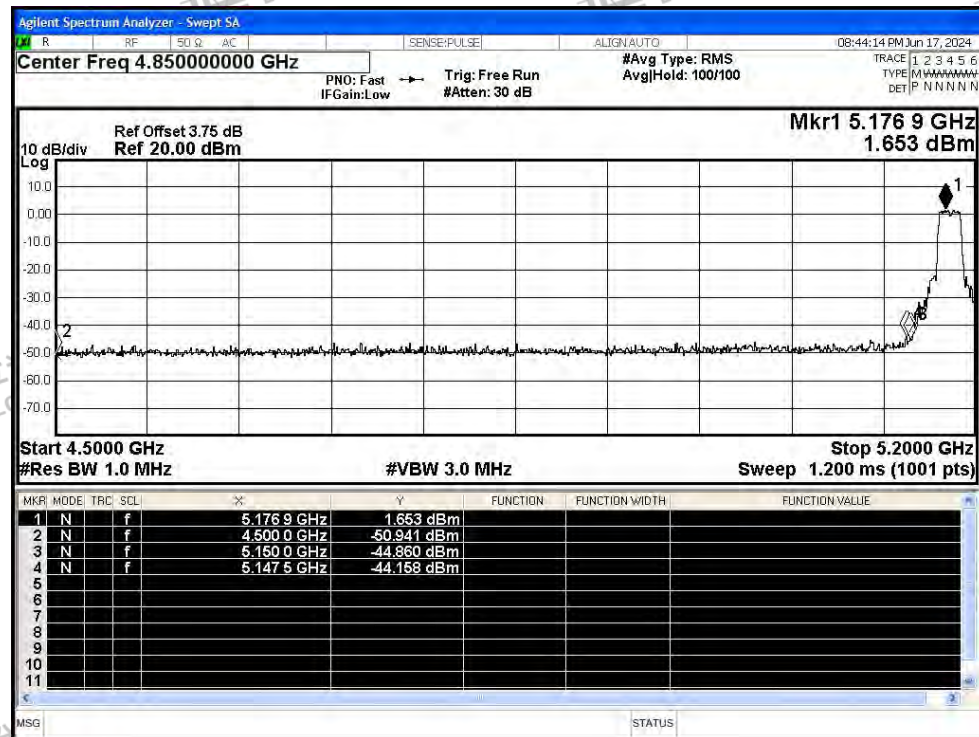

Restrict Band NVNT a 5180MHz Ant3 Average

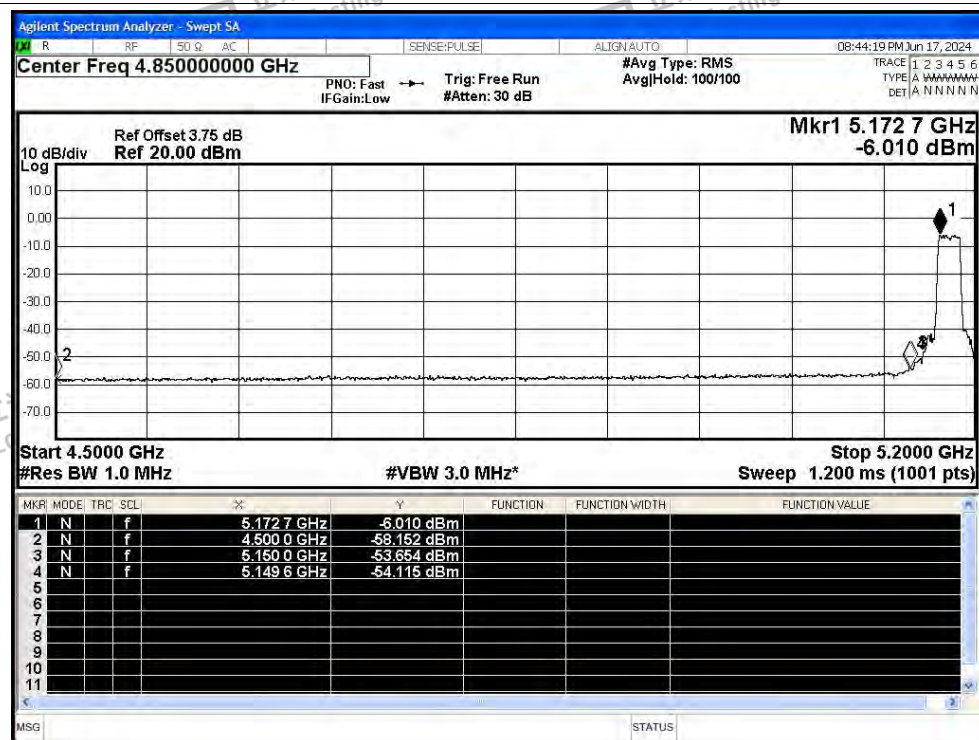

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant3 Peak

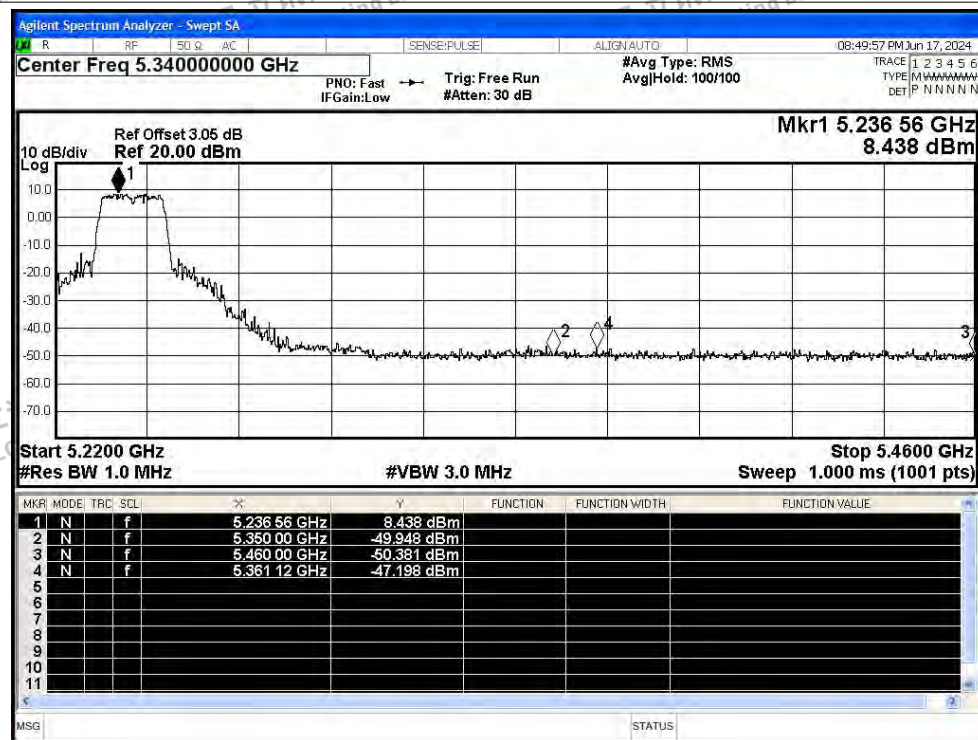

Restrict Band NVNT a 5240MHz Ant3 Average

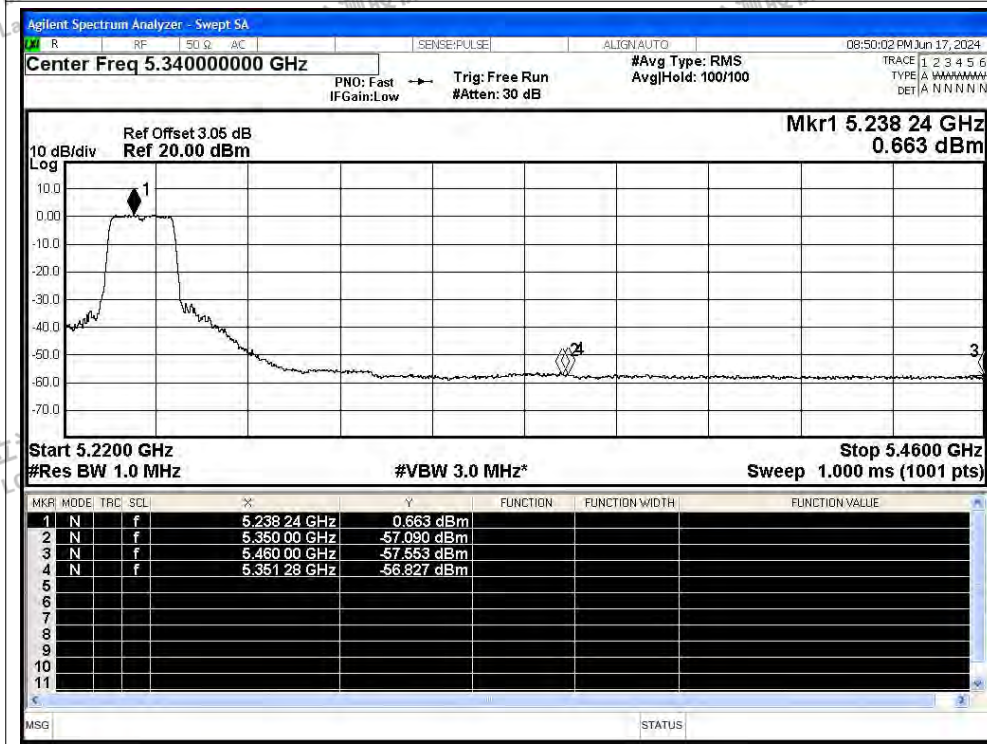

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant3 Peak

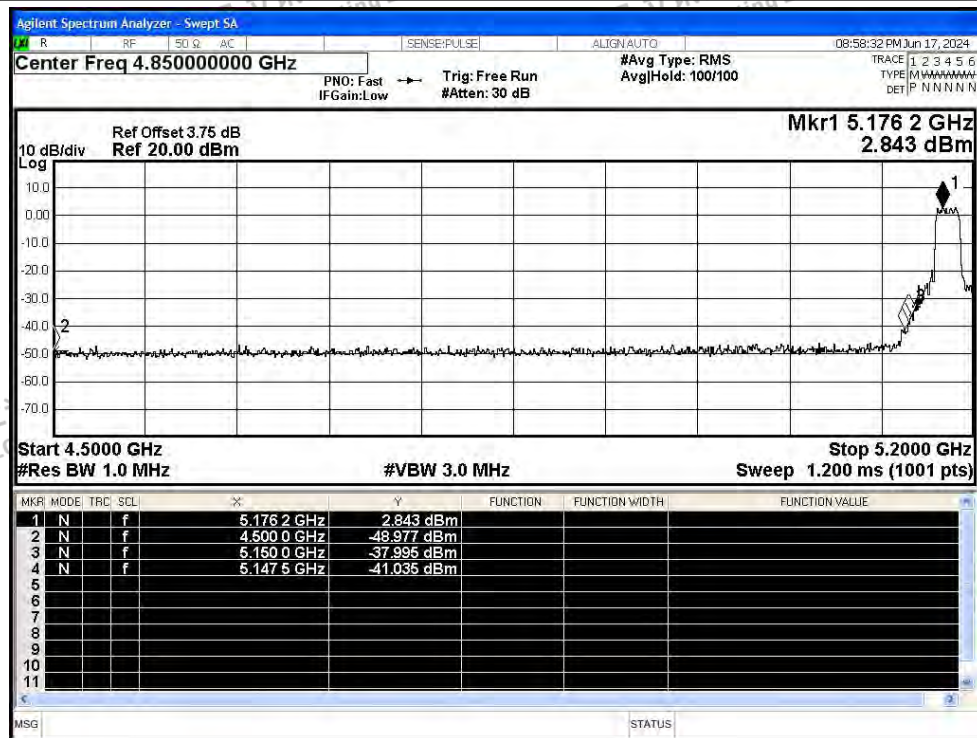

Restrict Band NVNT n20 5180MHz Ant3 Average

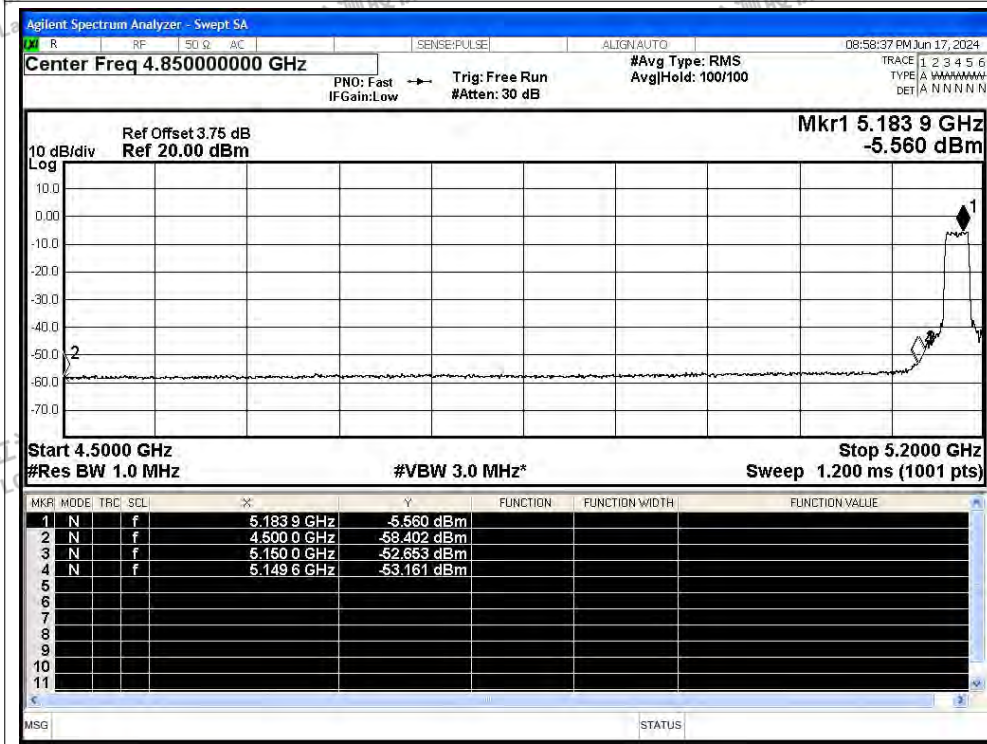

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant3 Peak

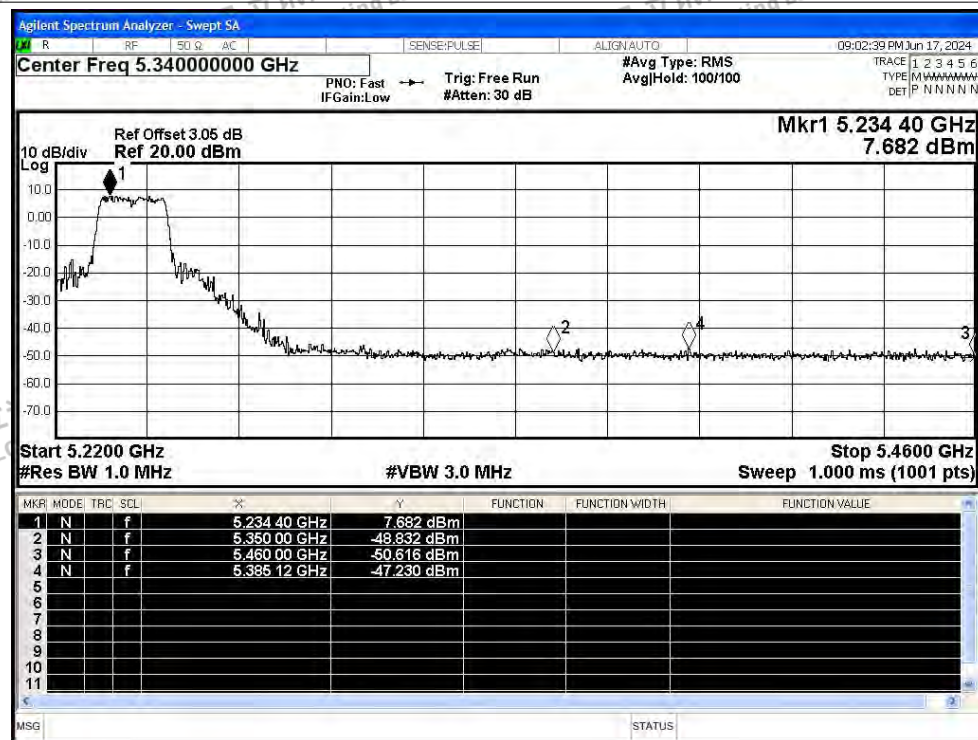

Restrict Band NVNT n20 5240MHz Ant3 Average

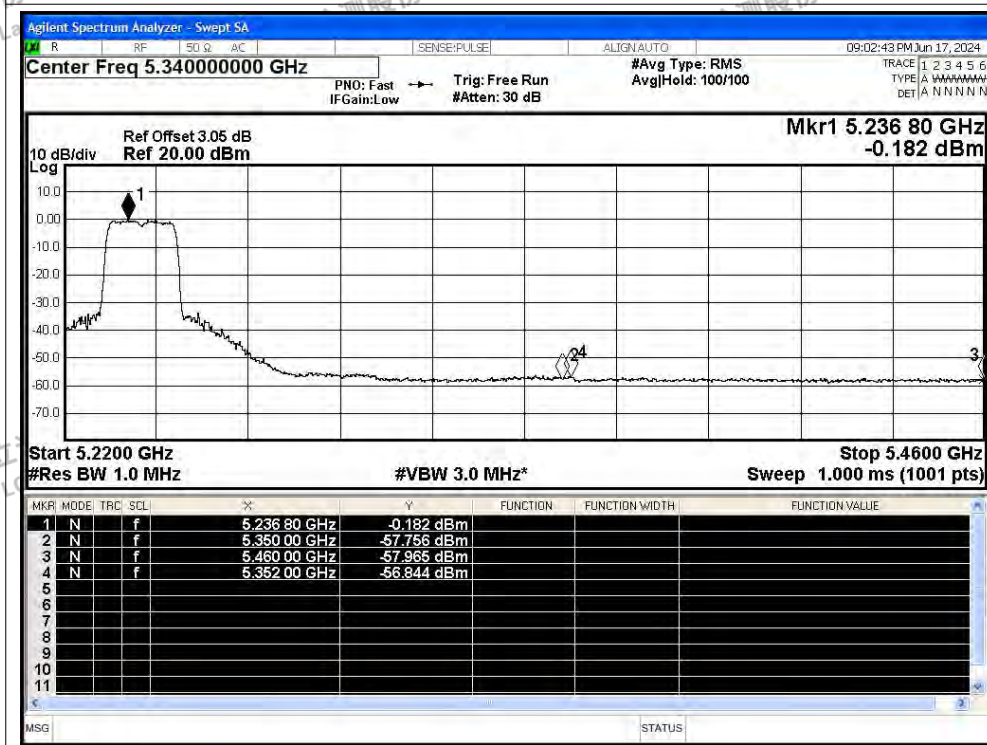

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant3 Peak

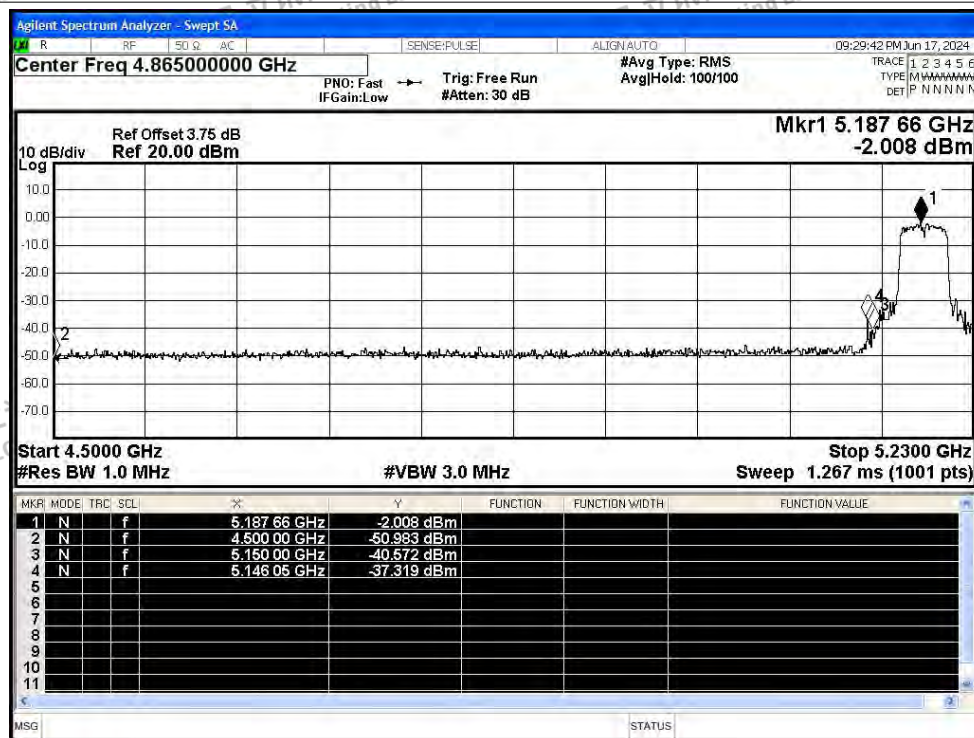

Restrict Band NVNT n40 5190MHz Ant3 Average

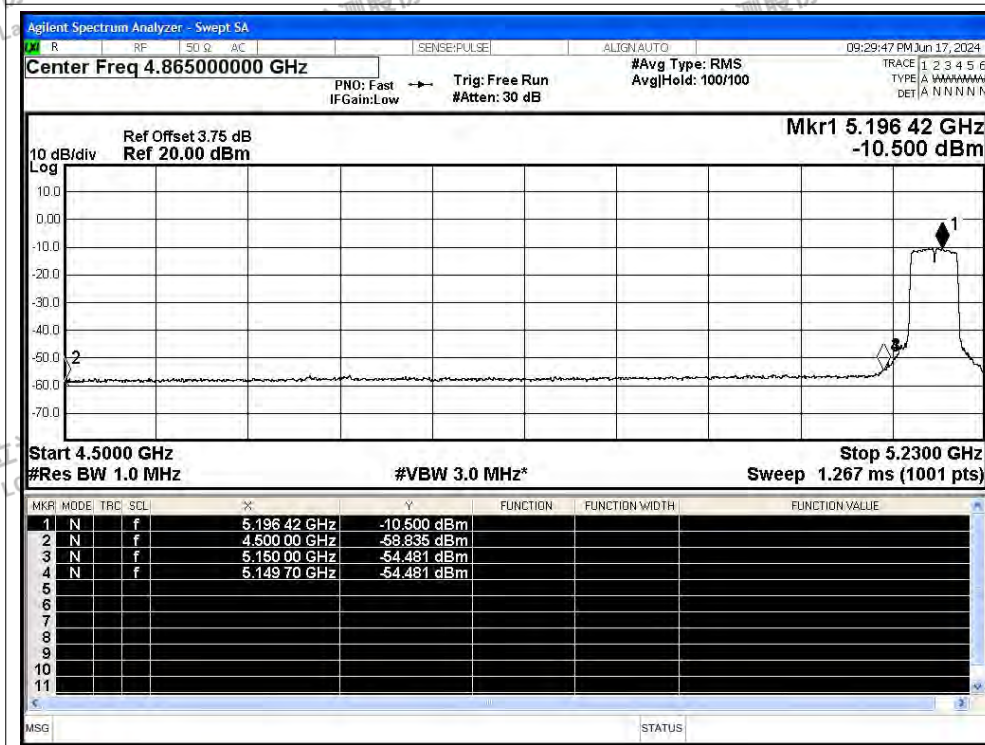

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant3 Peak

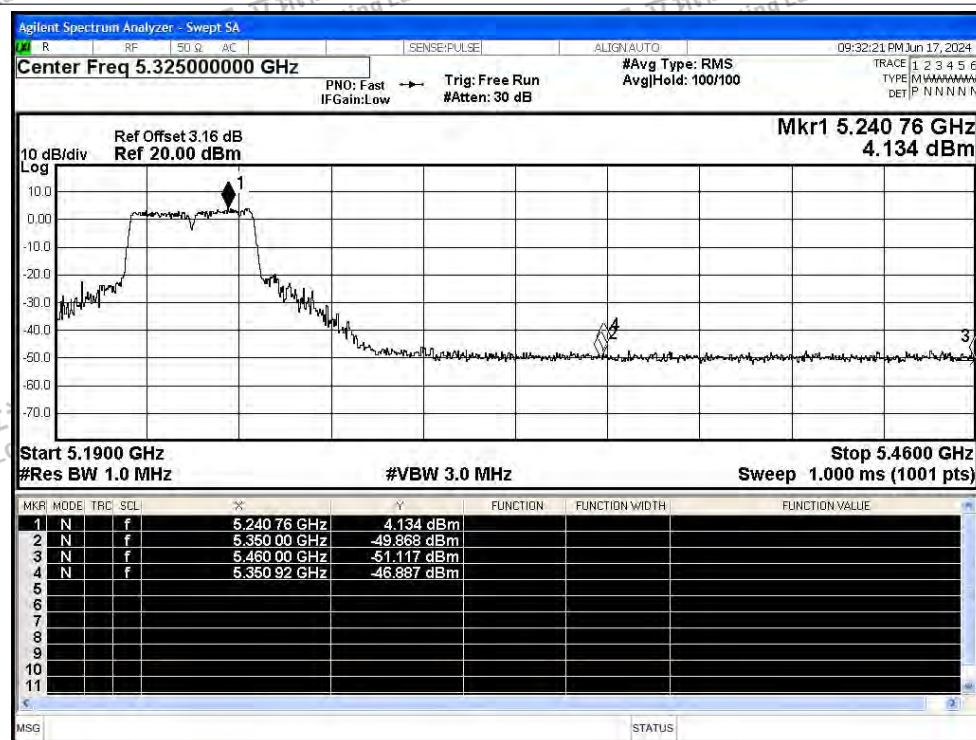

Restrict Band NVNT n40 5230MHz Ant3 Average

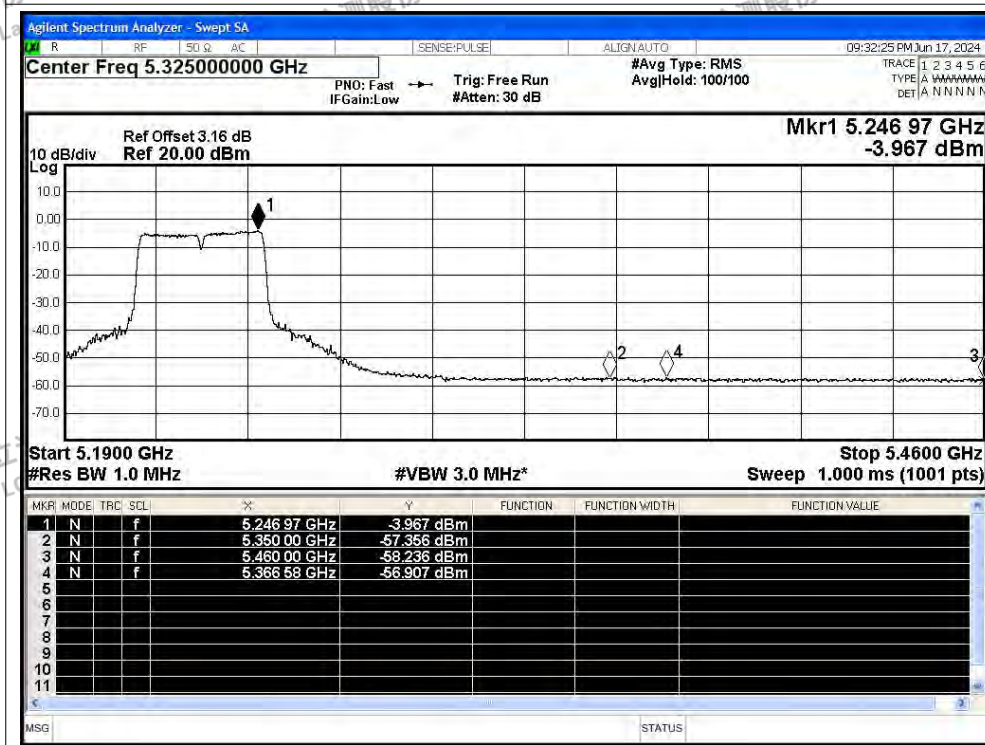

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant3 Peak

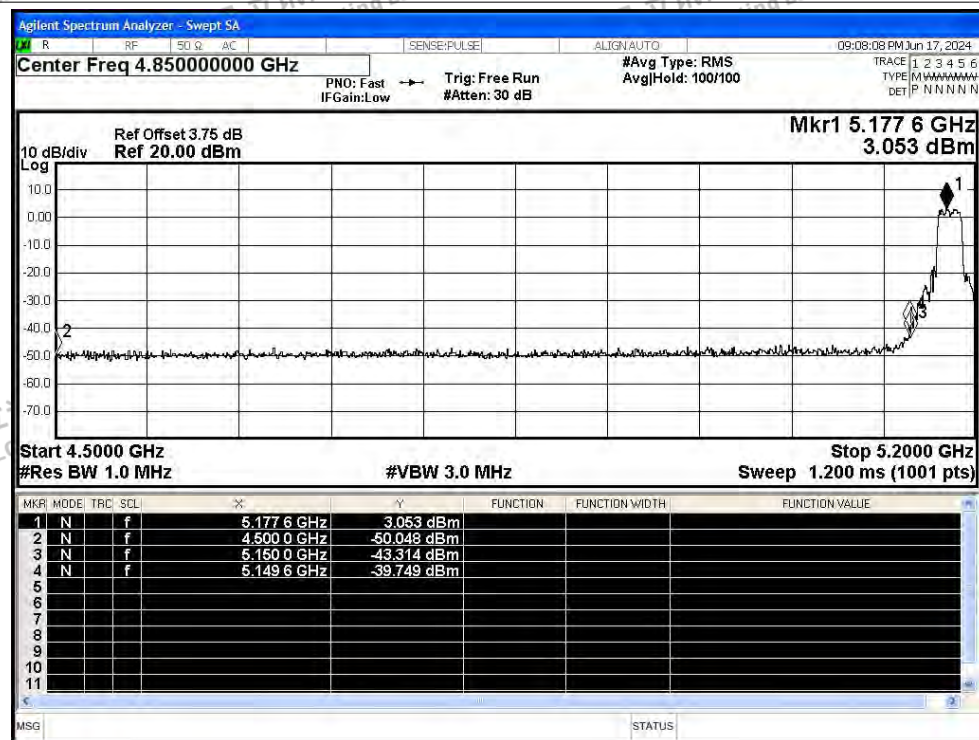

Restrict Band NVNT ac20 5180MHz Ant3 Average

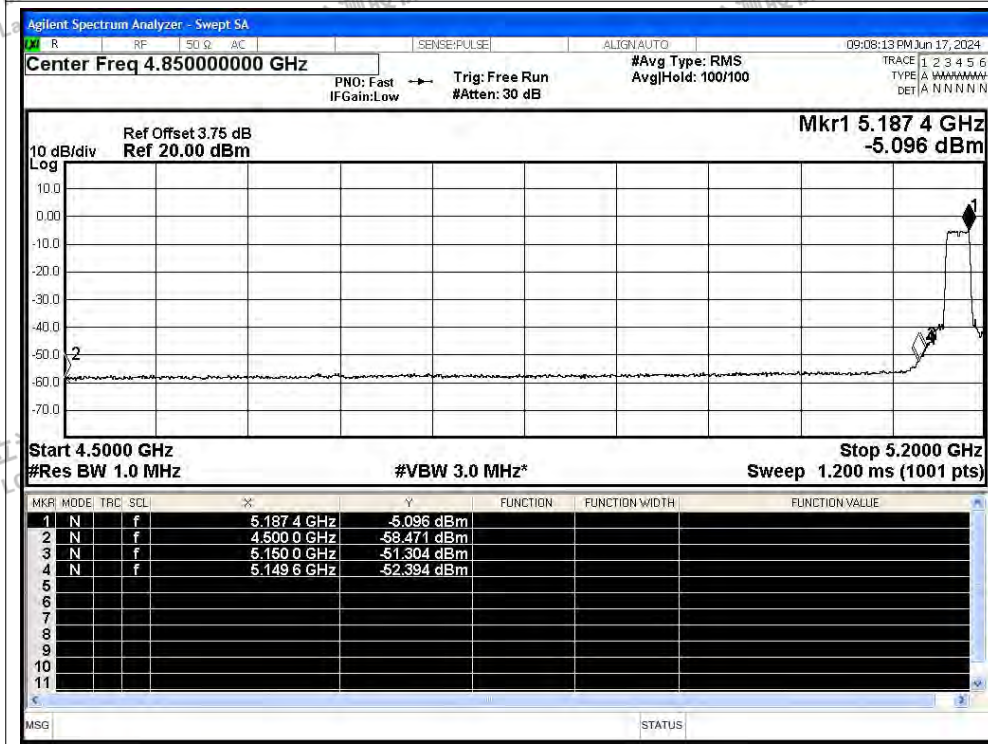

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant3 Peak

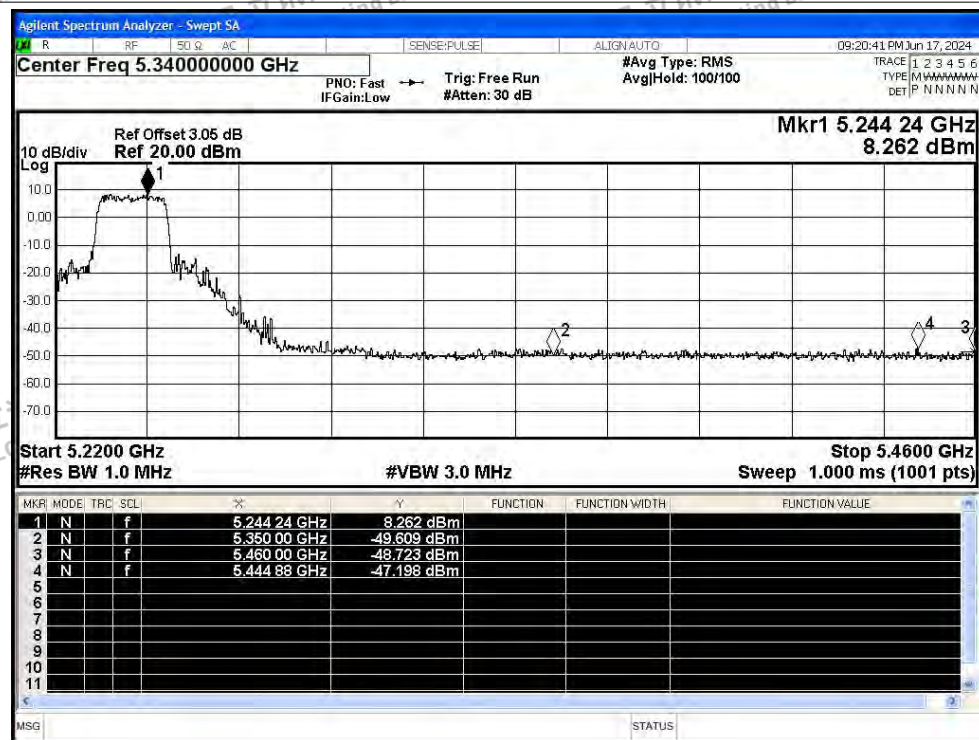

Restrict Band NVNT ac20 5240MHz Ant3 Average

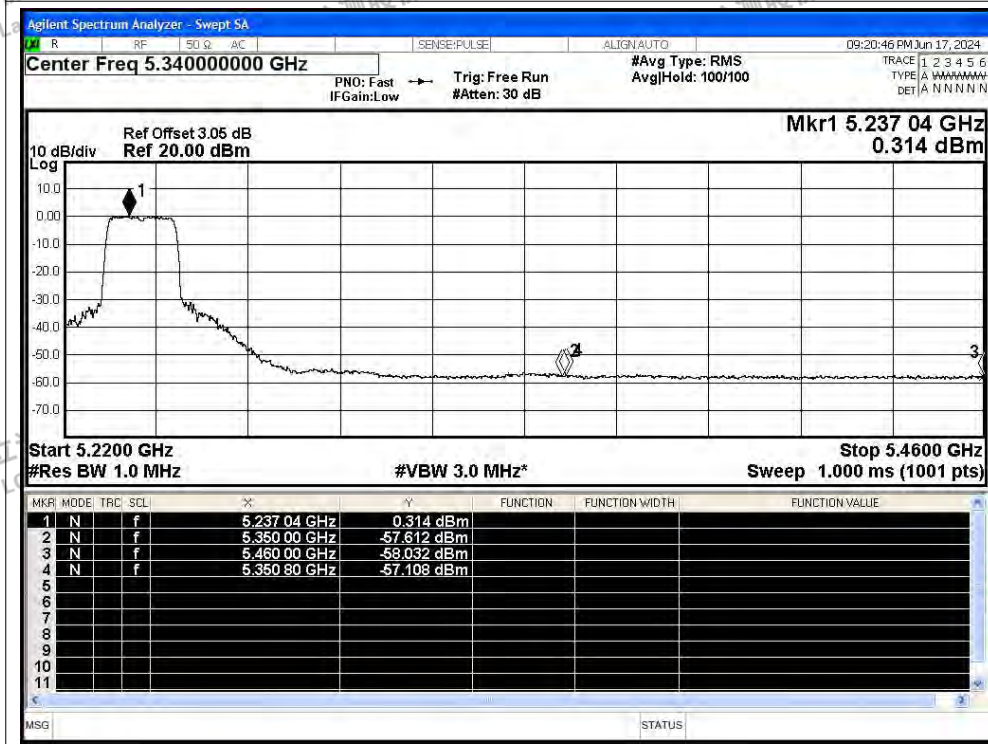

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant3 Peak

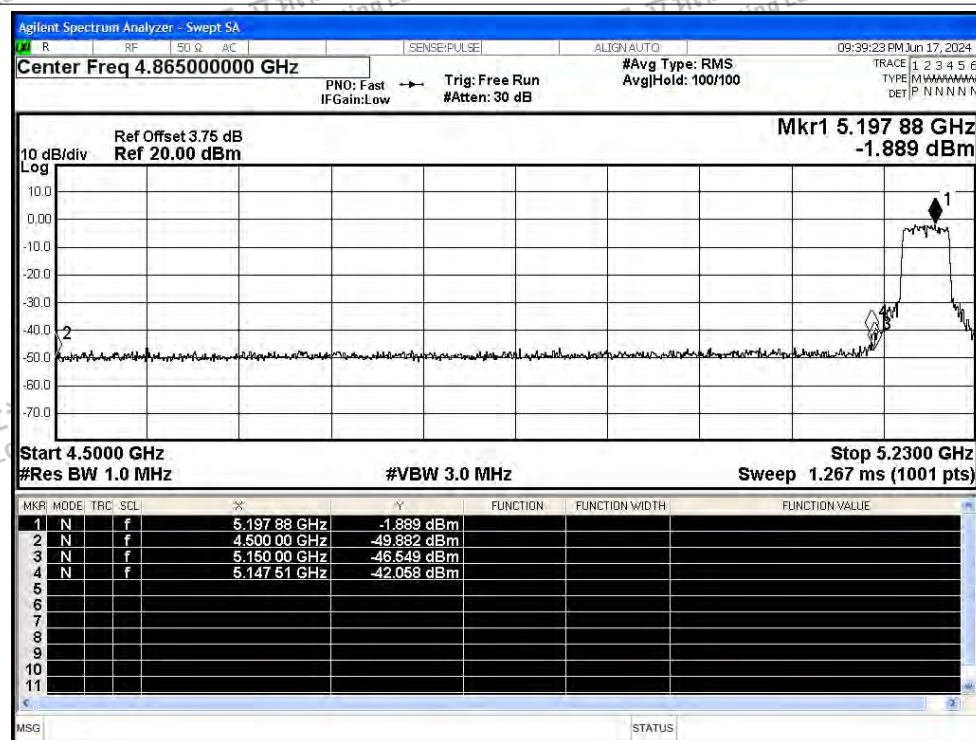

Restrict Band NVNT ac40 5190MHz Ant3 Average

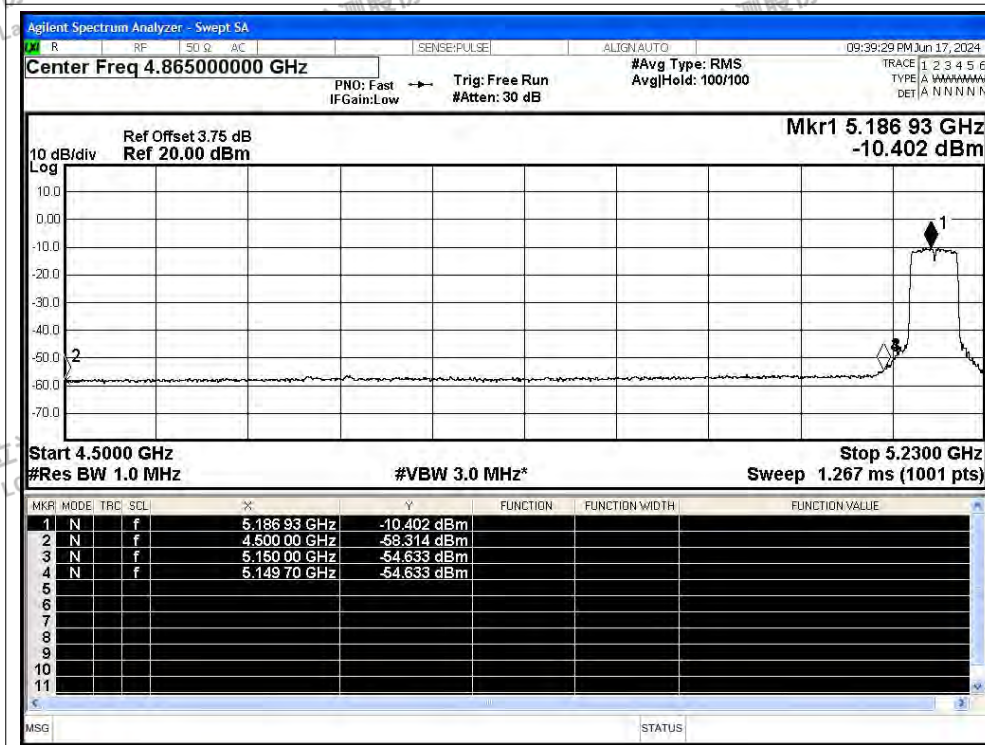

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant3 Peak

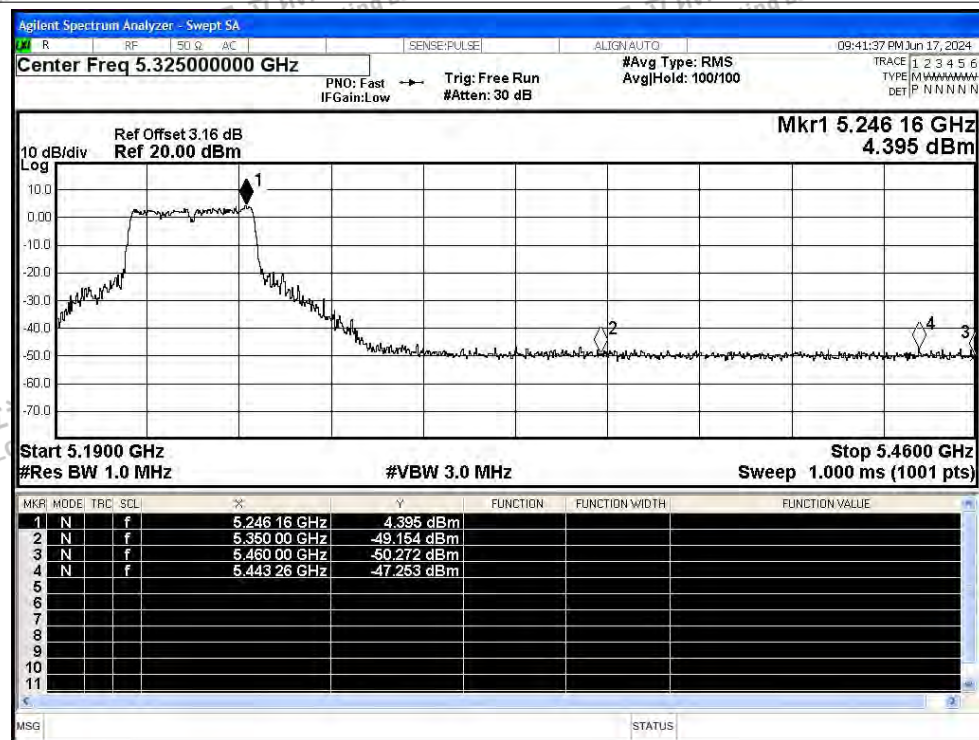

Restrict Band NVNT ac40 5230MHz Ant3 Average

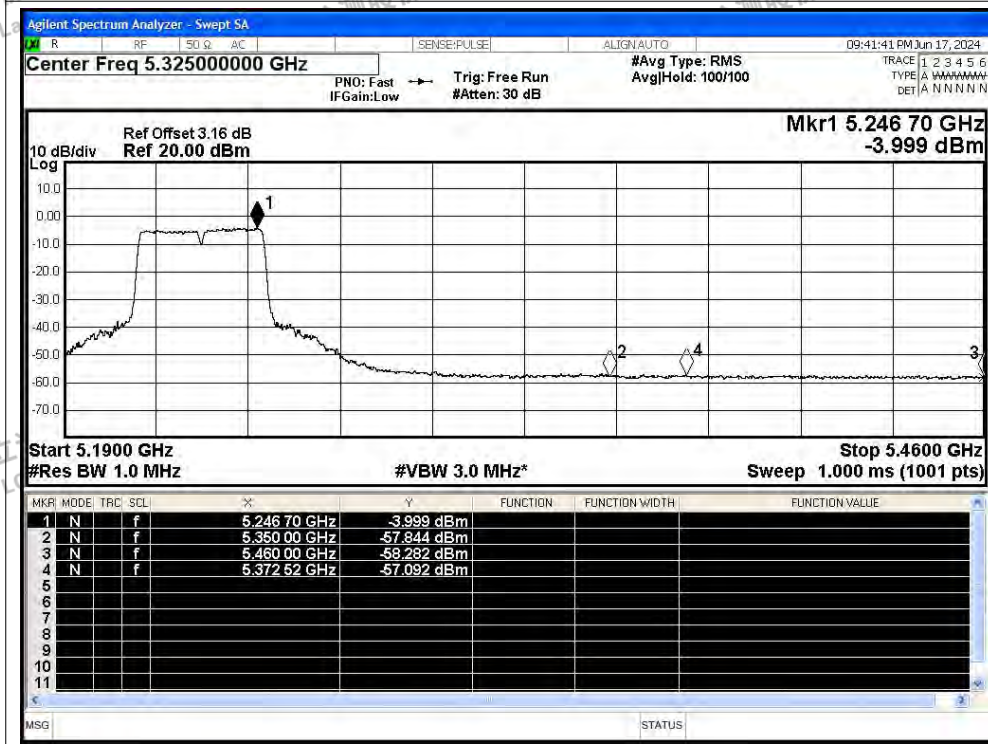

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak

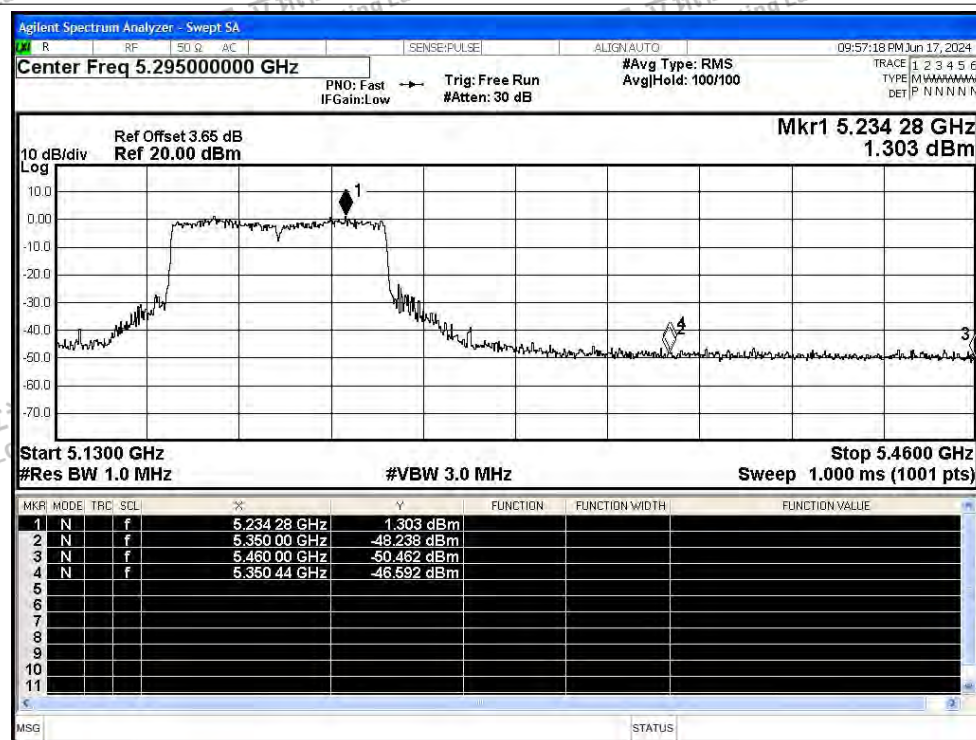

Restrict Band NVNT ac80 5210MHz Ant3 Average

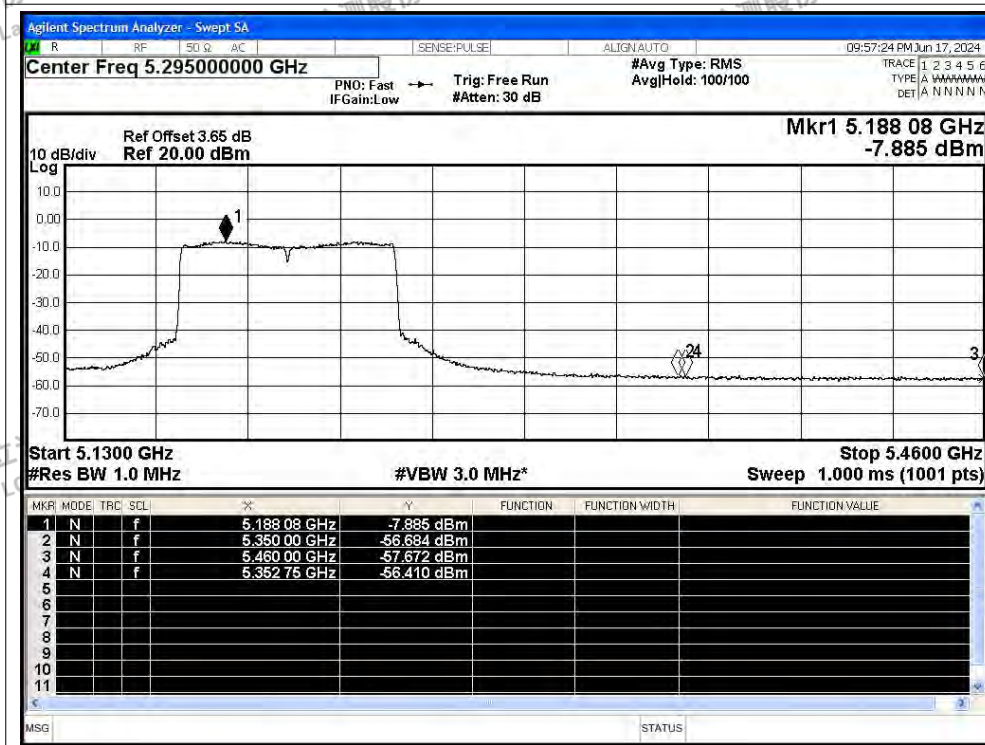

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant3 Peak



Restrict Band NVNT ac80 5210MHz Ant3 Average

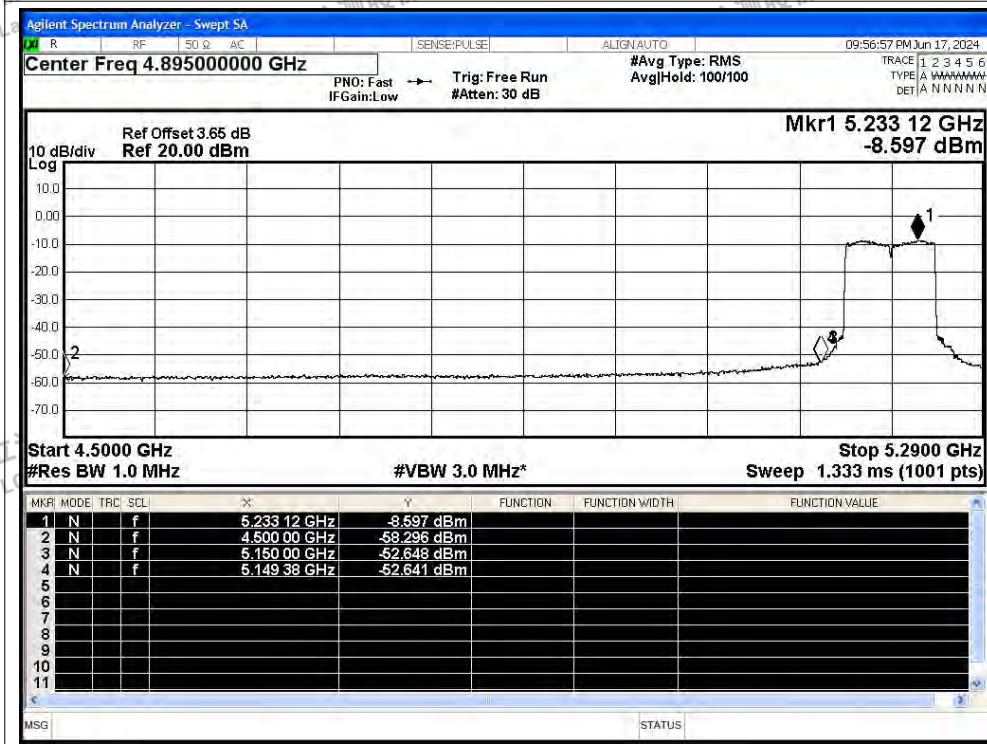

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant3 Peak

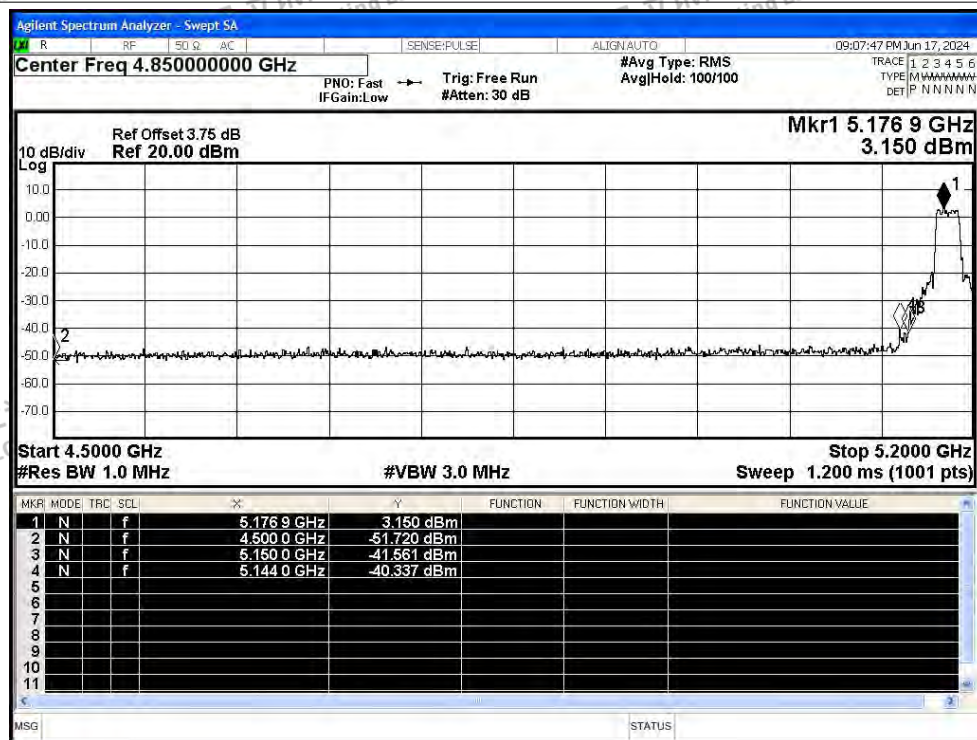

Restrict Band NVNT ax20 5180MHz Ant3 Average

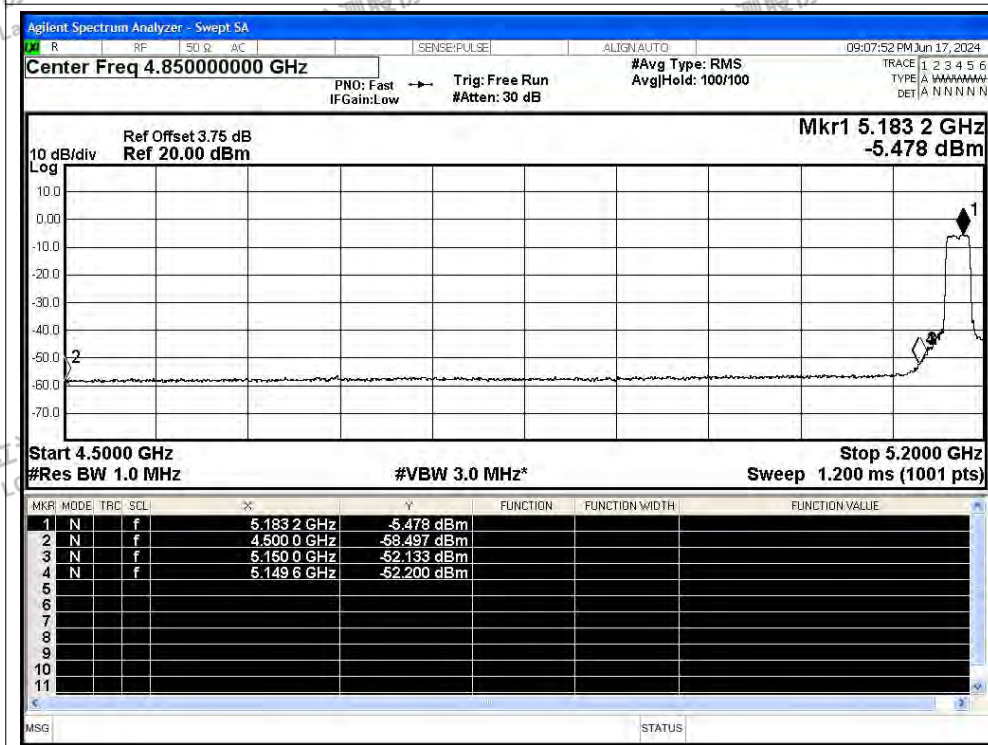

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant3 Peak

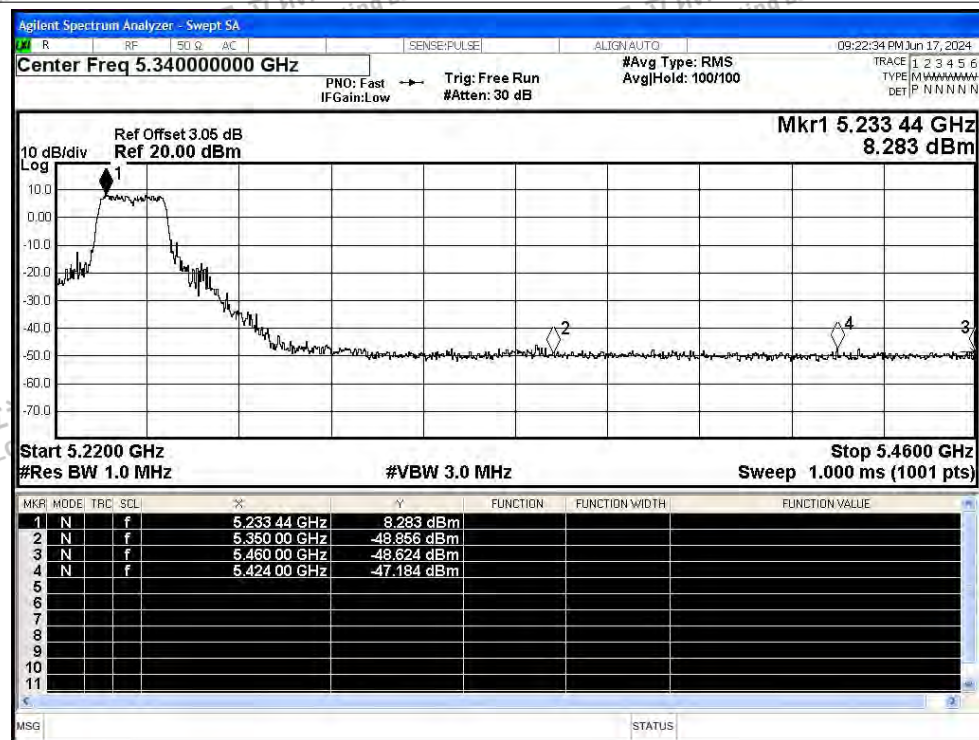

Restrict Band NVNT ax20 5240MHz Ant3 Average

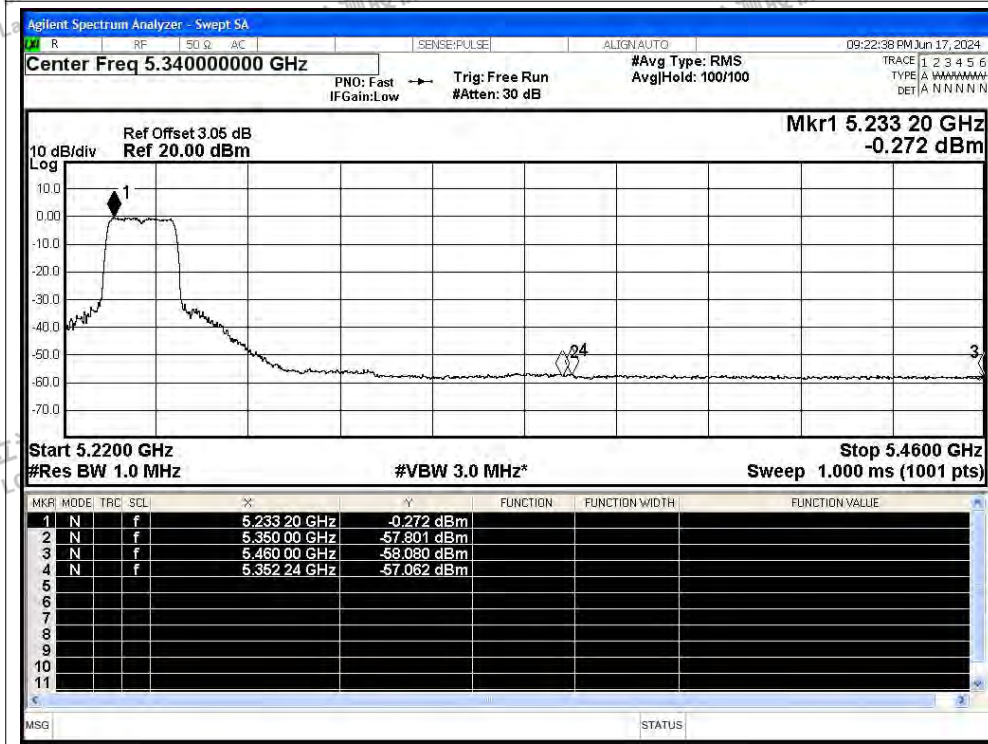

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant3 Peak

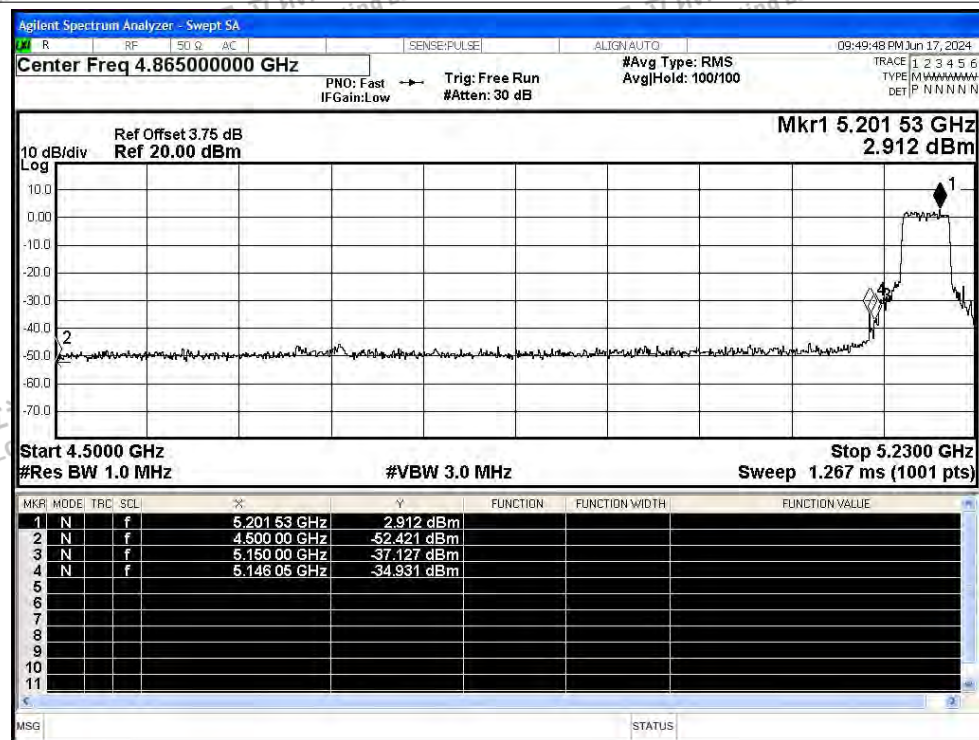

Restrict Band NVNT ax40 5190MHz Ant3 Average

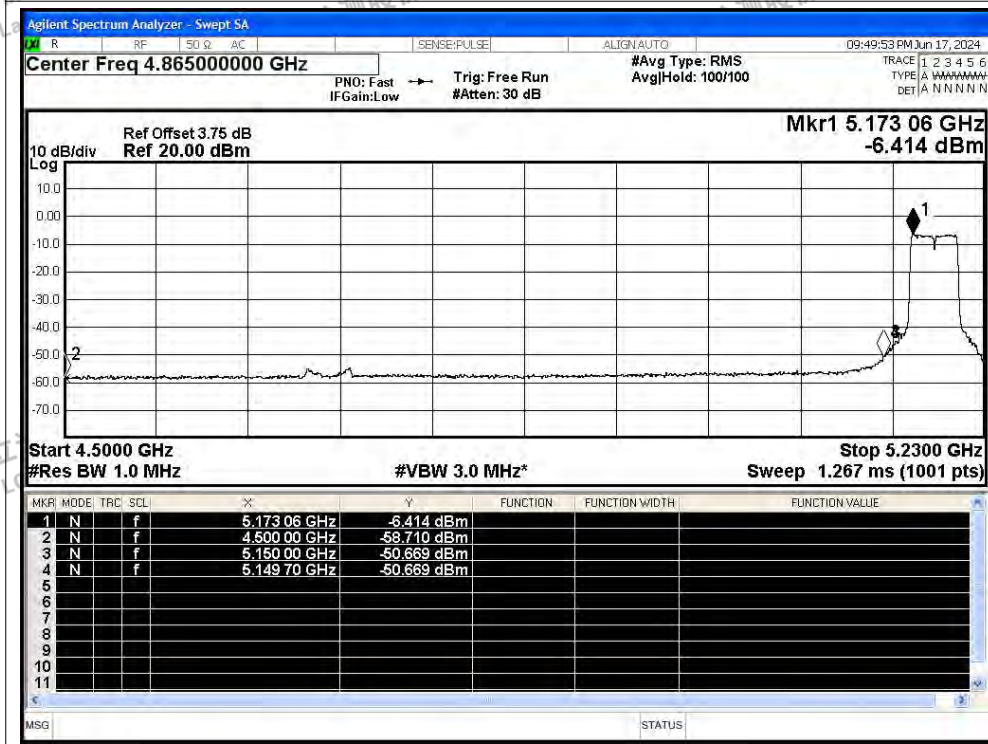

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant3 Peak

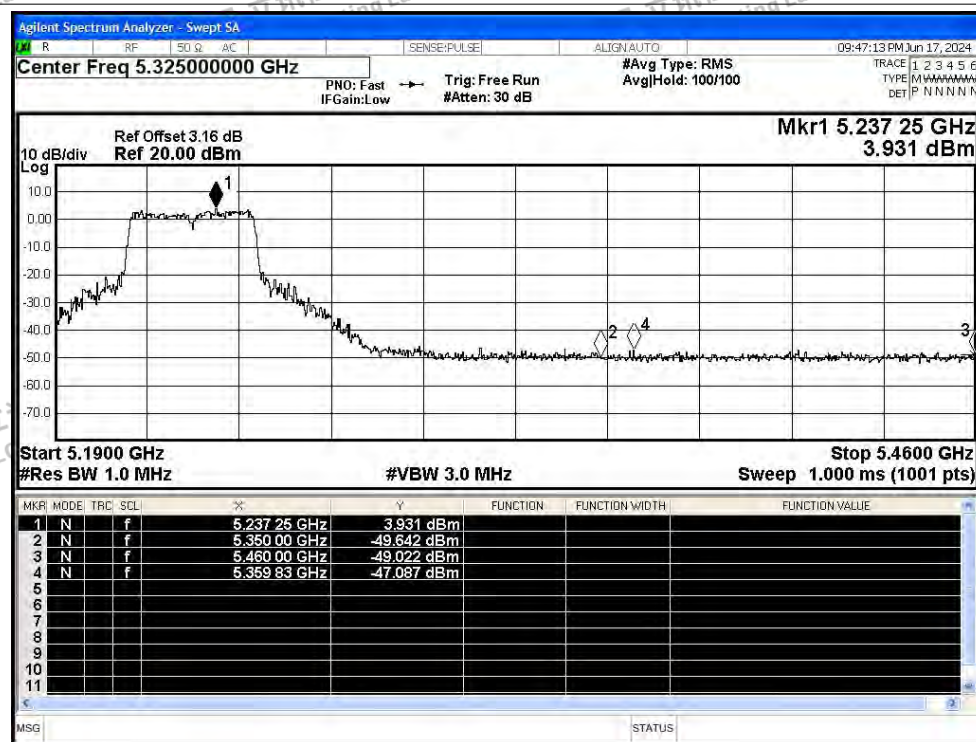

Restrict Band NVNT ax40 5230MHz Ant3 Average

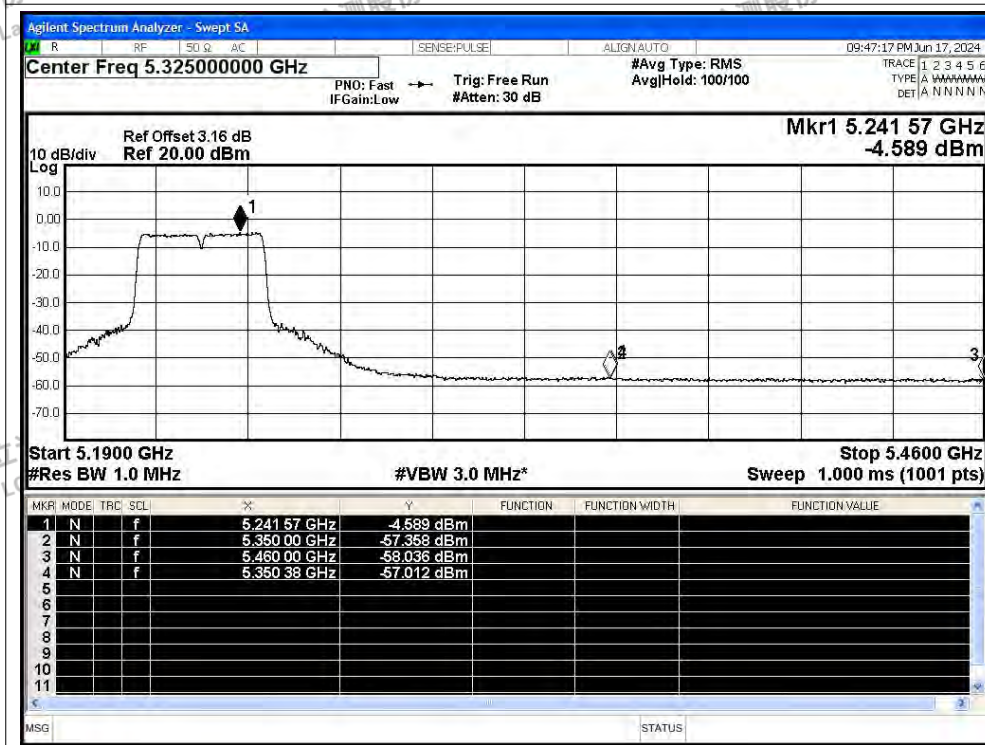

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

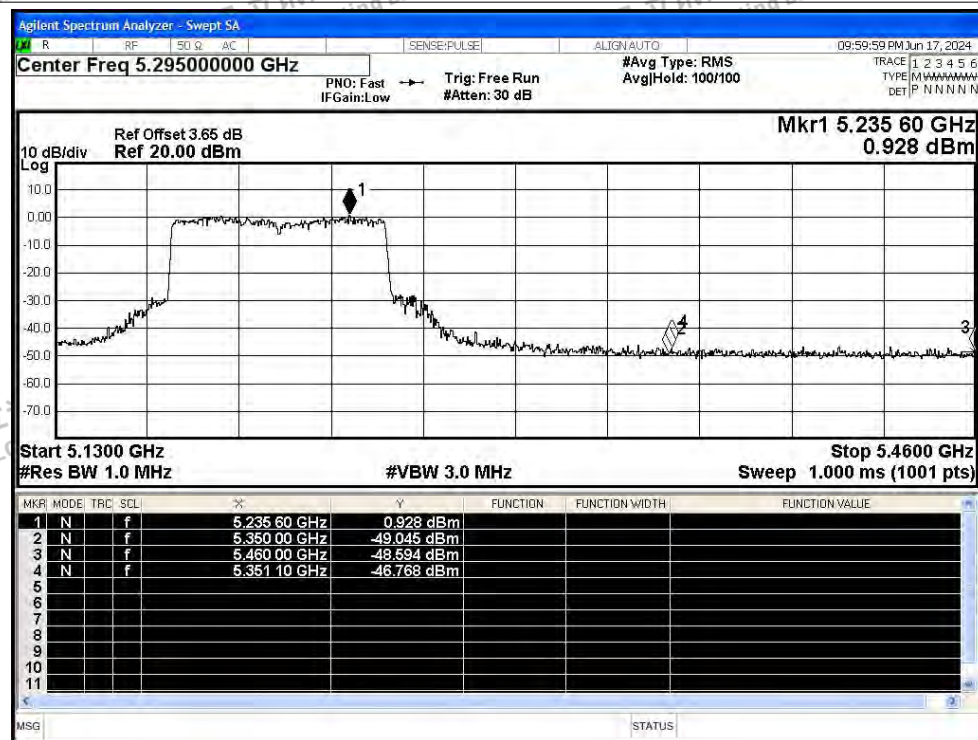

Restrict Band NVNT ax80 5210MHz Ant3 Average

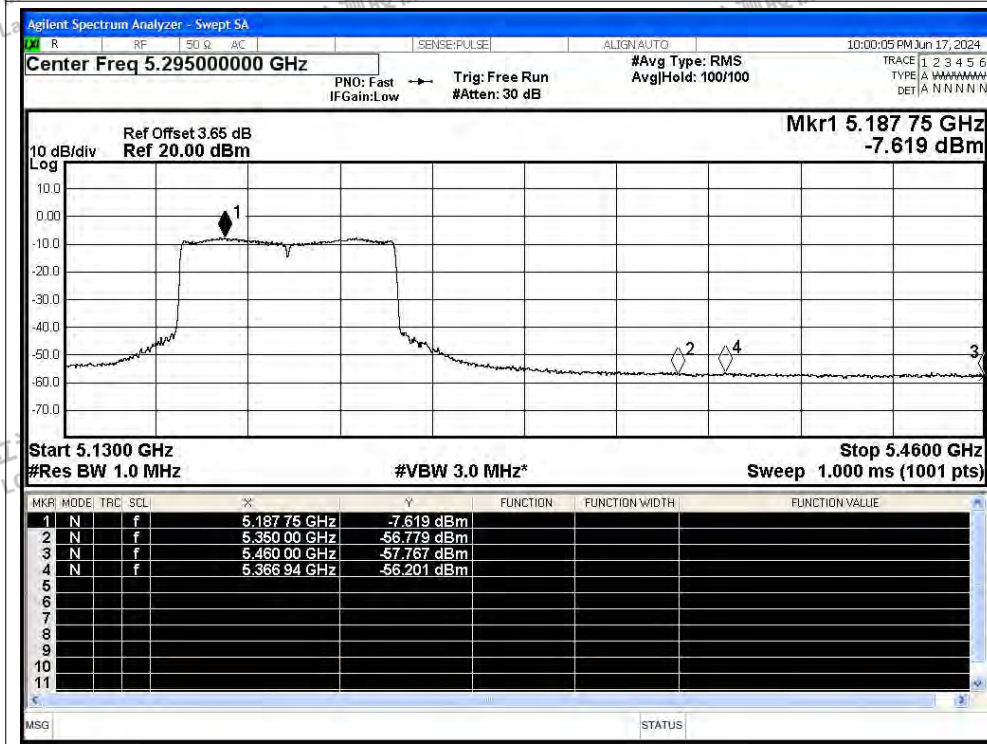

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant3 Peak

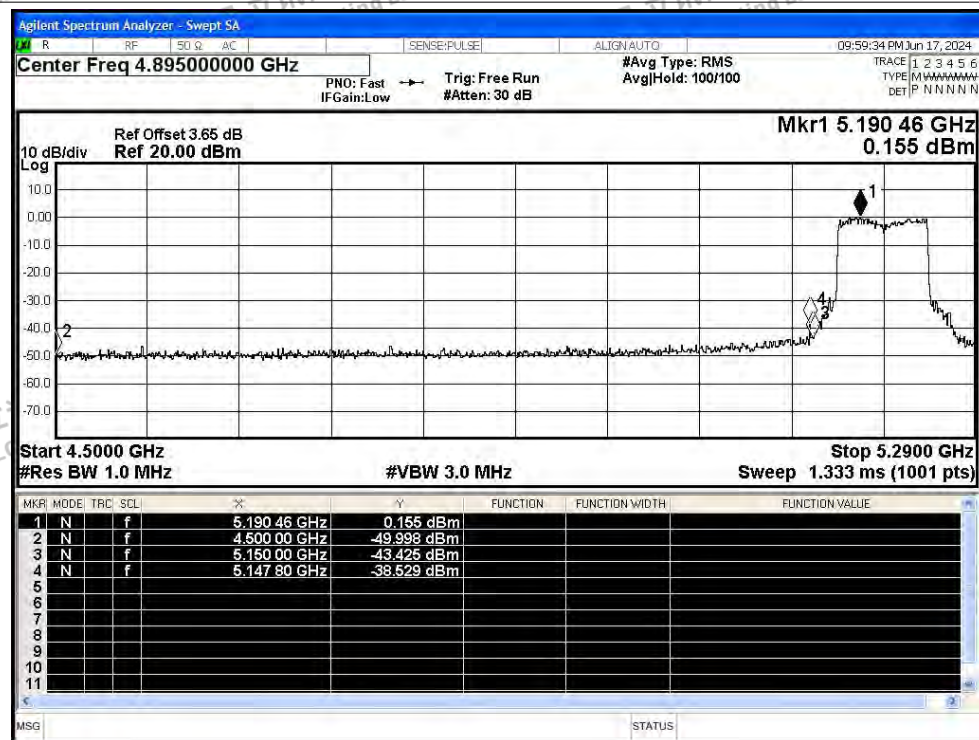

Restrict Band NVNT ax80 5210MHz Ant3 Average

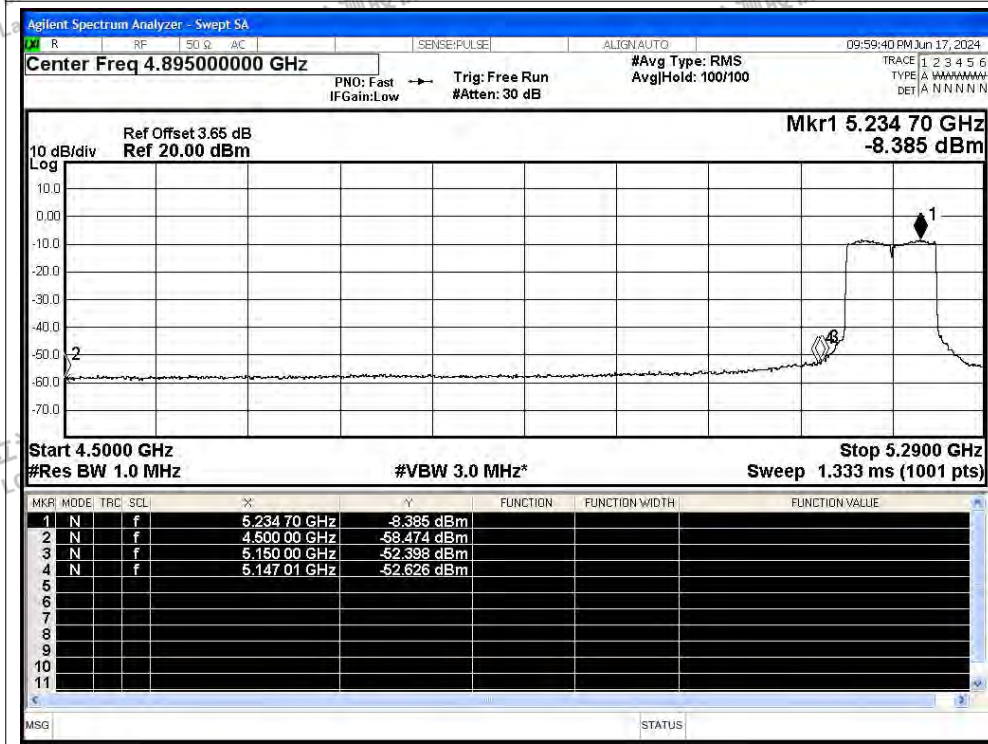

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant4	4500	-49.5	3.59	-	49.35	Peak	68.2	Pass
NVNT	a	5180	Ant4	4500	-58.67	3.59	0	40.18	Average	54	Pass
NVNT	a	5180	Ant4	5001.2	-45.46	3.59	-	53.39	Peak	68.2	Pass
NVNT	a	5180	Ant4	5149.6	-55.7	3.59	0	43.15	Average	54	Pass
NVNT	a	5180	Ant4	5150	-47.45	3.59	-	51.40	Peak	68.2	Pass
NVNT	a	5180	Ant4	5150	-55.81	3.59	0	43.04	Average	54	Pass
NVNT	a	5240	Ant4	5350	-49.29	3.59	-	49.56	Peak	68.2	Pass
NVNT	a	5240	Ant4	5350	-58.43	3.59	0	40.42	Average	54	Pass
NVNT	a	5240	Ant4	5422.32	-46.33	3.59	-	52.52	Peak	68.2	Pass
NVNT	a	5240	Ant4	5367.36	-57.21	3.59	0	41.64	Average	54	Pass
NVNT	a	5240	Ant4	5460	-47.11	3.59	-	51.74	Peak	68.2	Pass
NVNT	a	5240	Ant4	5460	-58.21	3.59	0	40.64	Average	54	Pass
NVNT	n20	5180	Ant4	4500	-50.08	3.59	-	48.77	Peak	68.2	Pass
NVNT	n20	5180	Ant4	4500	-58.4	3.59	0	40.45	Average	54	Pass
NVNT	n20	5180	Ant4	5146.8	-43.52	3.59	-	55.33	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5146.8	-55.86	3.59	0	42.99	Average	54	Pass
NVNT	n20	5180	Ant4	5150	-48.65	3.59	-	50.20	Peak	68.2	Pass
NVNT	n20	5180	Ant4	5150	-55.67	3.59	0	43.18	Average	54	Pass
NVNT	n20	5240	Ant4	5350	-49.99	3.59	-	48.86	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5350	-58.32	3.59	0	40.53	Average	54	Pass
NVNT	n20	5240	Ant4	5388.24	-47.36	3.59	-	51.49	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5375.04	-57.27	3.59	0	41.58	Average	54	Pass
NVNT	n20	5240	Ant4	5460	-50.24	3.59	-	48.61	Peak	68.2	Pass
NVNT	n20	5240	Ant4	5460	-57.58	3.59	0	41.27	Average	54	Pass
NVNT	n40	5190	Ant4	4500	-48.74	3.59	-	50.11	Peak	68.2	Pass
NVNT	n40	5190	Ant4	4500	-58.52	3.59	0	40.33	Average	54	Pass
NVNT	n40	5190	Ant4	5079.62	-46.15	3.59	-	52.70	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5149.7	-55.34	3.59	0	43.51	Average	54	Pass
NVNT	n40	5190	Ant4	5150	-47.17	3.59	-	51.68	Peak	68.2	Pass
NVNT	n40	5190	Ant4	5150	-55.34	3.59	0	43.51	Average	54	Pass
NVNT	n40	5230	Ant4	5350	-51.02	3.59	-	47.83	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5350	-58.21	3.59	0	40.64	Average	54	Pass
NVNT	n40	5230	Ant4	5430.84	-47.4	3.59	-	51.45	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5454.87	-57.18	3.59	0	41.67	Average	54	Pass
NVNT	n40	5230	Ant4	5460	-49.63	3.59	-	49.22	Peak	68.2	Pass
NVNT	n40	5230	Ant4	5460	-58.01	3.59	0	40.84	Average	54	Pass
NVNT	ac20	5180	Ant4	4500	-50.7	3.59	-	48.15	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant4	4500	-58.12	3.59	0	40.73	Average	54	Pass
NVNT	ac20	5180	Ant4	5131.4	-46.3	3.59	-	52.55	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	5067.7	-55.8	3.59	0	43.05	Average	54	Pass
NVNT	ac20	5180	Ant4	5150	-47.11	3.59	-	51.74	Peak	68.2	Pass
NVNT	ac20	5180	Ant4	5150	-56.42	3.59	0	42.43	Average	54	Pass
NVNT	ac20	5240	Ant4	5350	-49.23	3.59	-	49.62	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5350	-57.32	3.59	0	41.53	Average	54	Pass
NVNT	ac20	5240	Ant4	5350.32	-47.6	3.59	-	51.25	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5364	-57.24	3.59	0	41.61	Average	54	Pass
NVNT	ac20	5240	Ant4	5460	-51.23	3.59	-	47.62	Peak	68.2	Pass
NVNT	ac20	5240	Ant4	5460	-57.79	3.59	0	41.06	Average	54	Pass
NVNT	ac40	5190	Ant4	4500	-50.4	3.59	-	48.45	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	4500	-58.39	3.59	0	40.46	Average	54	Pass
NVNT	ac40	5190	Ant4	5097.87	-45.28	3.59	-	53.57	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5148.97	-55.53	3.59	0	43.32	Average	54	Pass
NVNT	ac40	5190	Ant4	5150	-48.45	3.59	-	50.40	Peak	68.2	Pass
NVNT	ac40	5190	Ant4	5150	-55.66	3.59	0	43.19	Average	54	Pass
NVNT	ac40	5230	Ant4	5350	-50.39	3.59	-	48.46	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5350	-58.43	3.59	0	40.42	Average	54	Pass
NVNT	ac40	5230	Ant4	5414.91	-46.91	3.59	-	51.94	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5435.97	-57.17	3.59	0	41.68	Average	54	Pass
NVNT	ac40	5230	Ant4	5460	-50.11	3.59	-	48.74	Peak	68.2	Pass
NVNT	ac40	5230	Ant4	5460	-57.8	3.59	0	41.05	Average	54	Pass
NVNT	ac80	5210	Ant4	5350	-49.9	3.59	-	48.95	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5350	-57.24	3.59	0.25	41.61	Average	54	Pass
NVNT	ac80	5210	Ant4	5409.84	-46.23	3.59	-	52.62	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5358.03	-56.29	3.59	0.25	42.56	Average	54	Pass
NVNT	ac80	5210	Ant4	5460	-48.1	3.59	-	50.75	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5460	-57.39	3.59	0.25	41.46	Average	54	Pass
NVNT	ac80	5210	Ant4	4500	-49.48	3.59	-	49.37	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	4500	-58.27	3.59	0	40.58	Average	54	Pass
NVNT	ac80	5210	Ant4	5043.52	-45.73	3.59	-	53.12	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5149.38	-55.87	3.59	0	42.98	Average	54	Pass
NVNT	ac80	5210	Ant4	5150	-45.61	3.59	-	53.24	Peak	68.2	Pass
NVNT	ac80	5210	Ant4	5150	-55.6	3.59	0	43.25	Average	54	Pass
NVNT	ax20	5180	Ant4	4500	-50.57	3.59	-	48.28	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	4500	-57.93	3.59	0	40.92	Average	54	Pass
NVNT	ax20	5180	Ant4	5047.4	-45.46	3.59	-	53.39	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	5069.8	-55.79	3.59	0	43.06	Average	54	Pass
NVNT	ax20	5180	Ant4	5150	-43.67	3.59	-	55.18	Peak	68.2	Pass
NVNT	ax20	5180	Ant4	5150	-54.91	3.59	0	43.94	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax20	5240	Ant4	5350	-49.83	3.59	-	49.02	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5350	-58.44	3.59	0	40.41	Average	54	Pass
NVNT	ax20	5240	Ant4	5366.88	-46.76	3.59	-	52.09	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5381.04	-57.31	3.59	0	41.54	Average	54	Pass
NVNT	ax20	5240	Ant4	5460	-50.23	3.59	-	48.62	Peak	68.2	Pass
NVNT	ax20	5240	Ant4	5460	-58.15	3.59	0	40.70	Average	54	Pass
NVNT	ax40	5190	Ant4	4500	-48.73	3.59	-	50.12	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	4500	-59.88	3.59	0	38.97	Average	54	Pass
NVNT	ax40	5190	Ant4	5147.51	-41.4	3.59	-	57.45	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5149.7	-54.04	3.59	0	44.81	Average	54	Pass
NVNT	ax40	5190	Ant4	5150	-46.11	3.59	-	52.74	Peak	68.2	Pass
NVNT	ax40	5190	Ant4	5150	-54.04	3.59	0	44.81	Average	54	Pass
NVNT	ax40	5230	Ant4	5350	-50.7	3.59	-	48.15	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5350	-58.32	3.59	0	40.53	Average	54	Pass
NVNT	ax40	5230	Ant4	5394.93	-47.27	3.59	-	51.58	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5391.15	-57.1	3.59	0	41.75	Average	54	Pass
NVNT	ax40	5230	Ant4	5460	-49.5	3.59	-	49.35	Peak	68.2	Pass
NVNT	ax40	5230	Ant4	5460	-58.14	3.59	0	40.71	Average	54	Pass
NVNT	ax80	5210	Ant4	5350	-49.7	3.59	-	49.15	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5350	-57.57	3.59	0	41.28	Average	54	Pass
NVNT	ax80	5210	Ant4	5388.39	-46.69	3.59	-	52.16	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5363.64	-56.51	3.59	0	42.34	Average	54	Pass
NVNT	ax80	5210	Ant4	5460	-49.11	3.59	-	49.74	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5460	-57.13	3.59	0	41.72	Average	54	Pass
NVNT	ax80	5210	Ant4	4500	-50.51	3.59	-	48.34	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	4500	-58.73	3.59	0	40.12	Average	54	Pass
NVNT	ax80	5210	Ant4	5148.59	-45.42	3.59	-	53.43	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5148.59	-55.65	3.59	0	43.20	Average	54	Pass
NVNT	ax80	5210	Ant4	5150	-46.8	3.59	-	52.05	Peak	68.2	Pass
NVNT	ax80	5210	Ant4	5150	-55.91	3.59	0	42.94	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

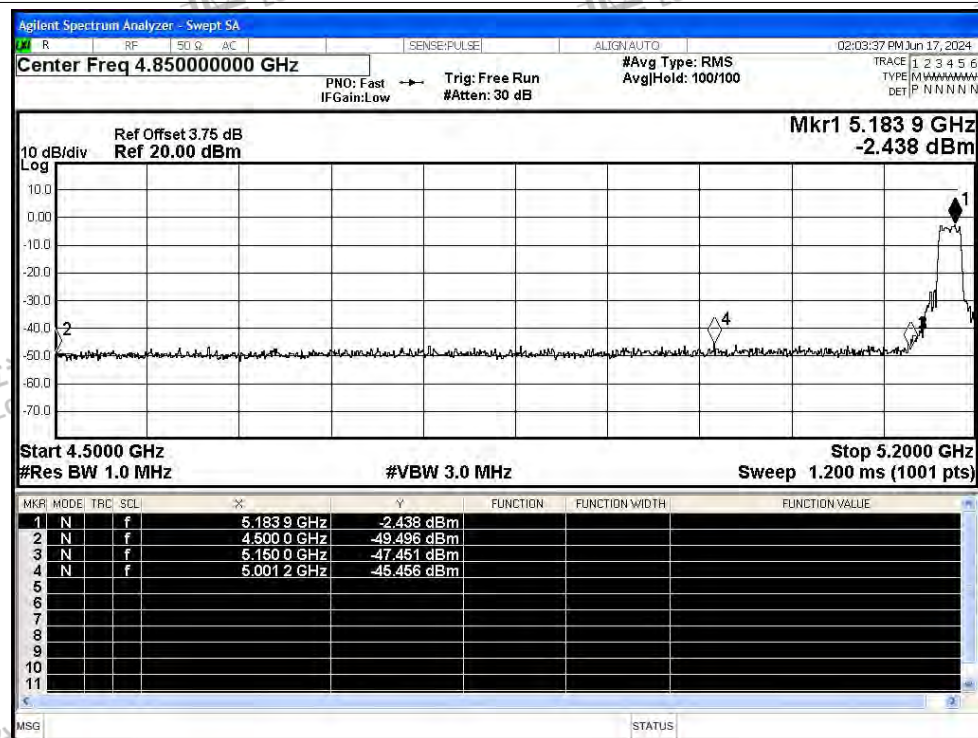

Restrict Band NVNT a 5180MHz Ant1 Average

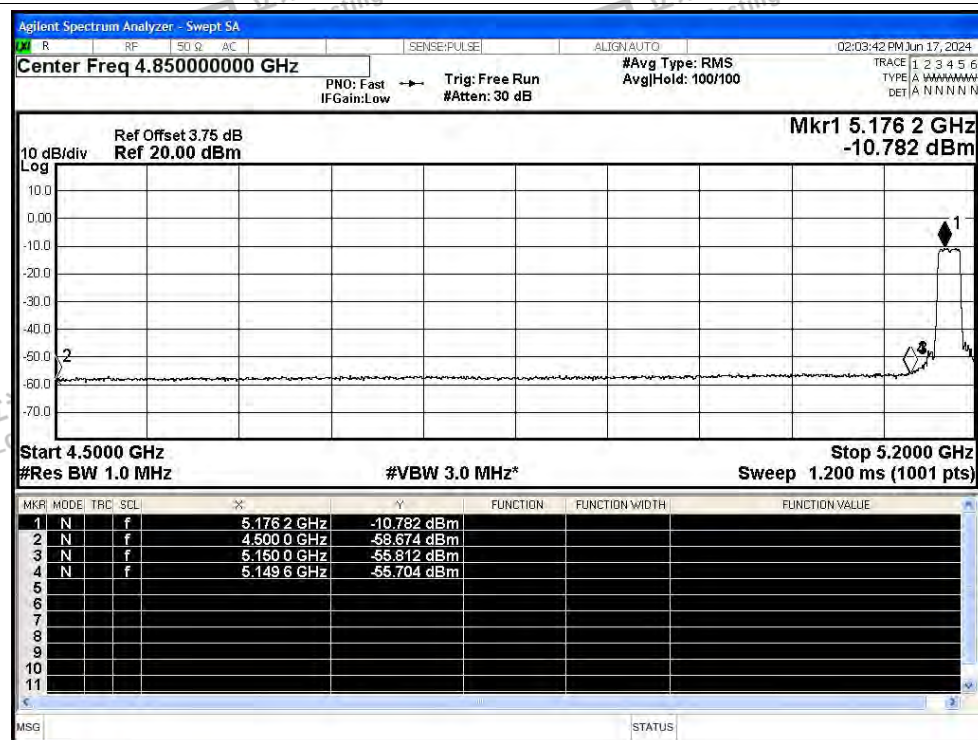

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

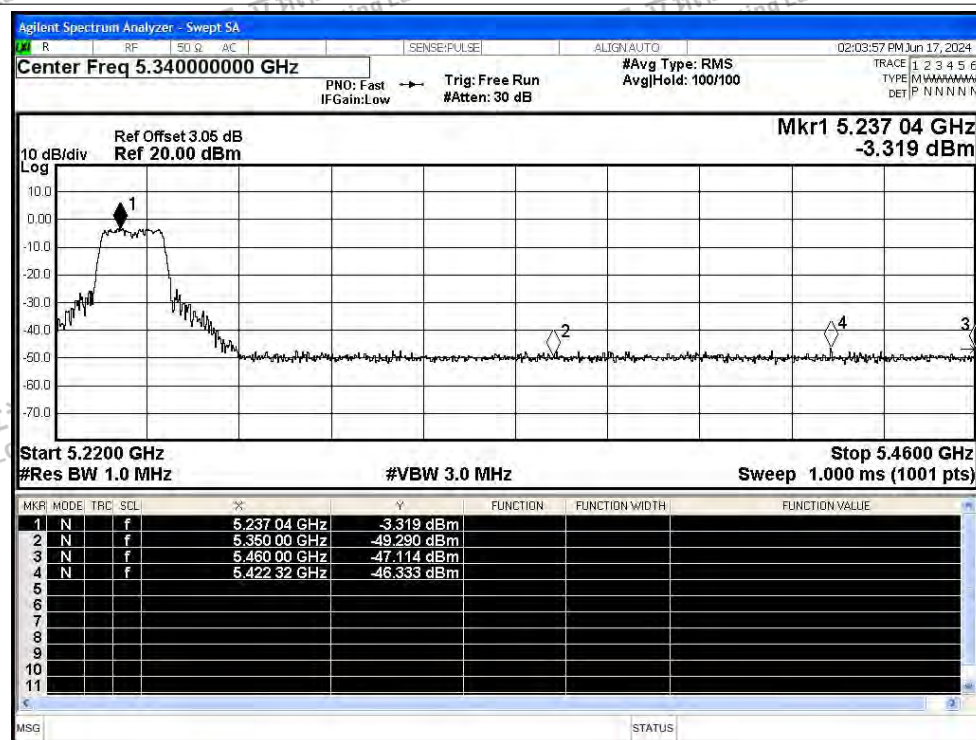

Restrict Band NVNT a 5240MHz Ant1 Average

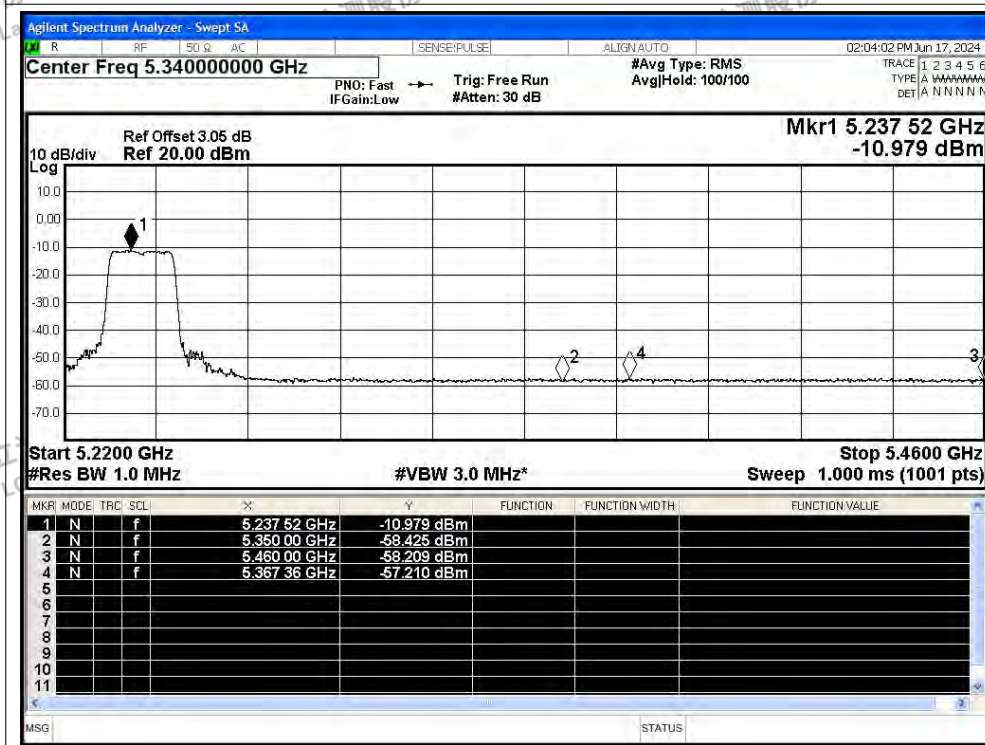

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

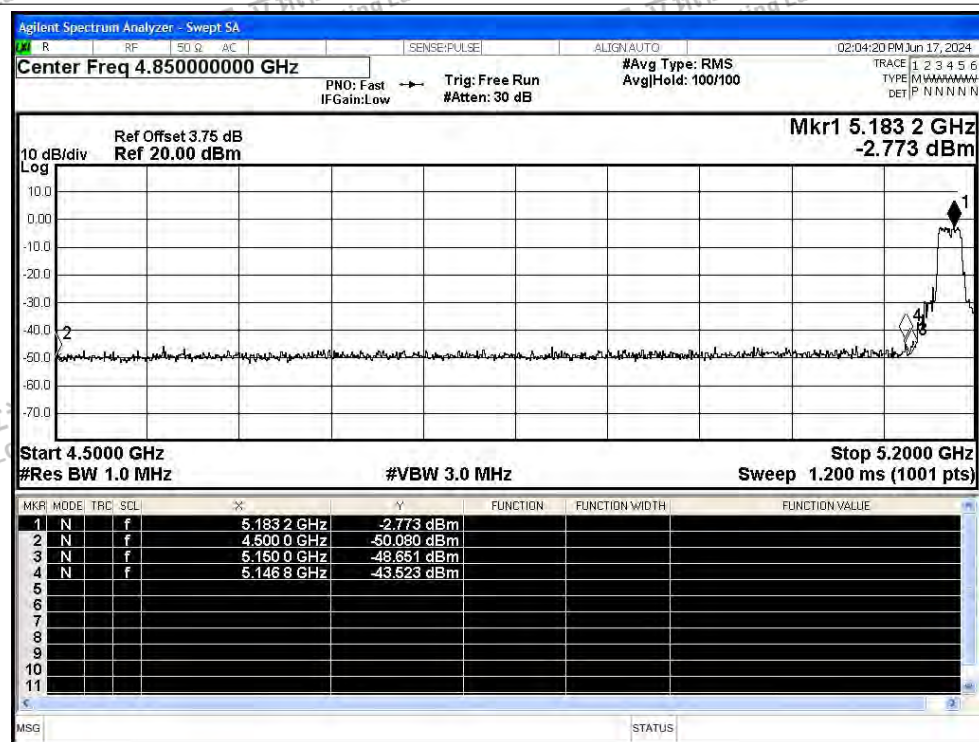

Restrict Band NVNT n20 5180MHz Ant1 Average

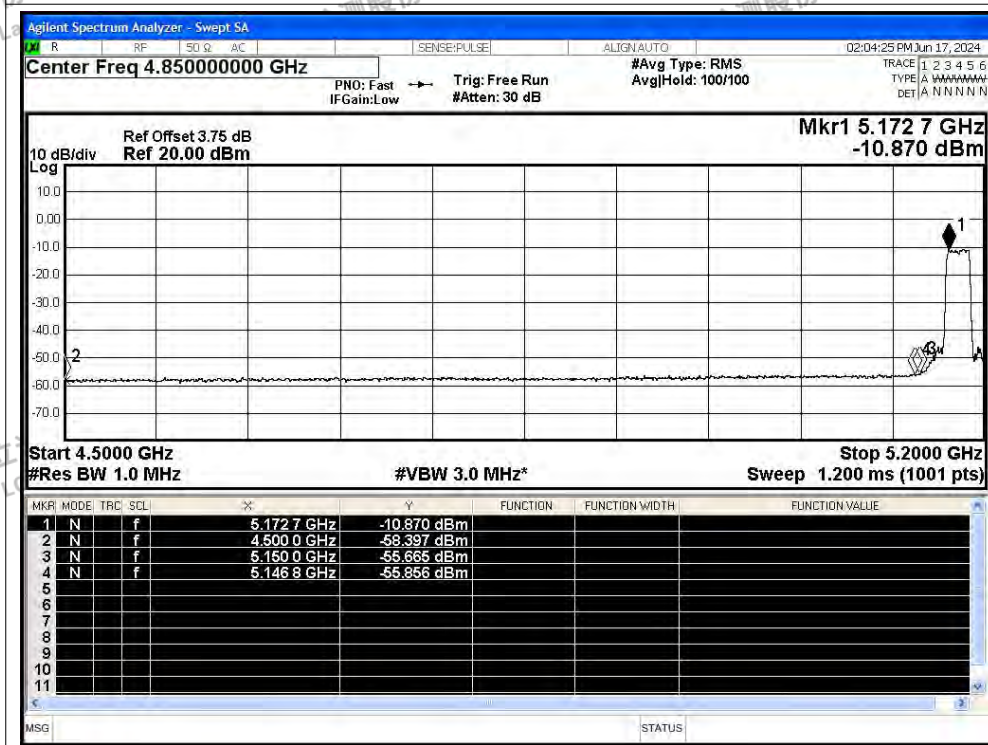

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

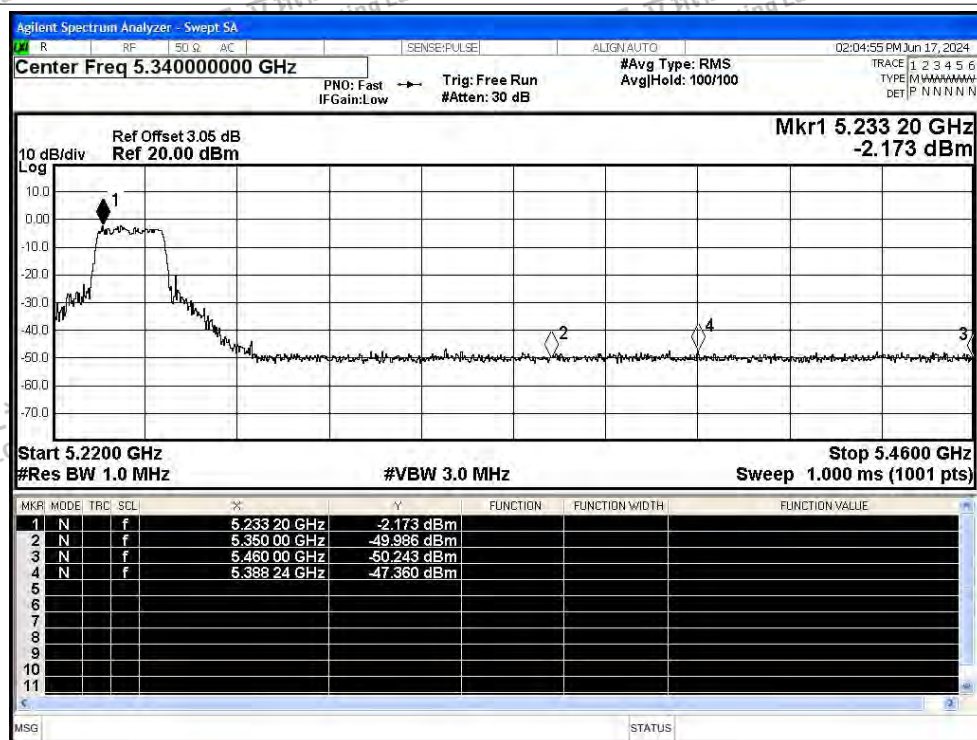

Restrict Band NVNT n20 5240MHz Ant1 Average

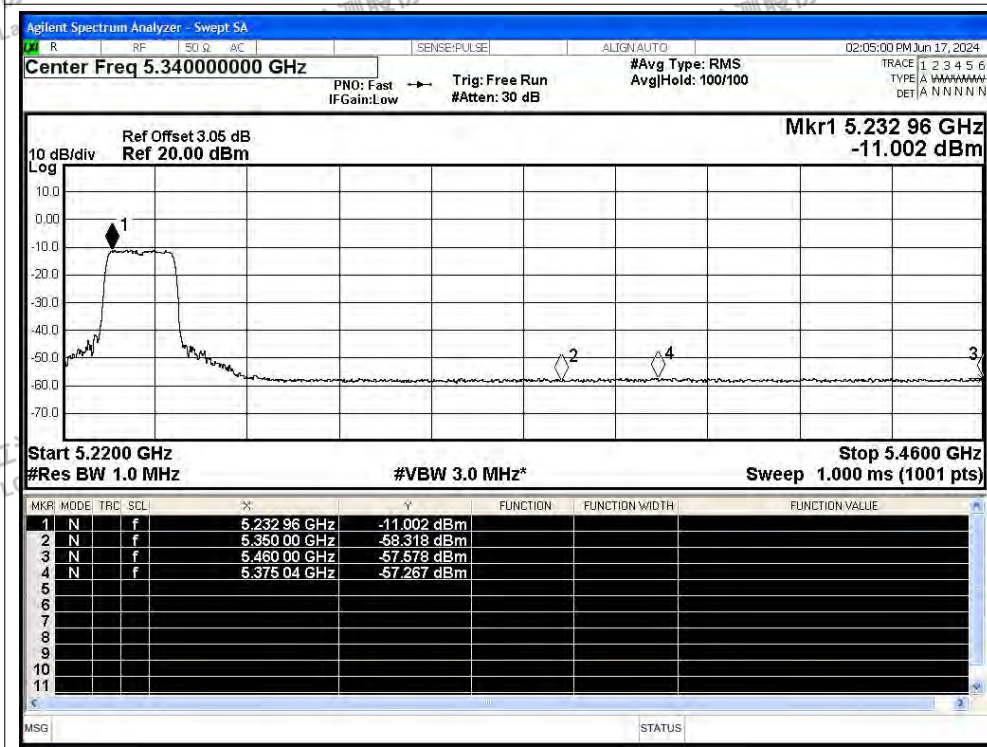

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

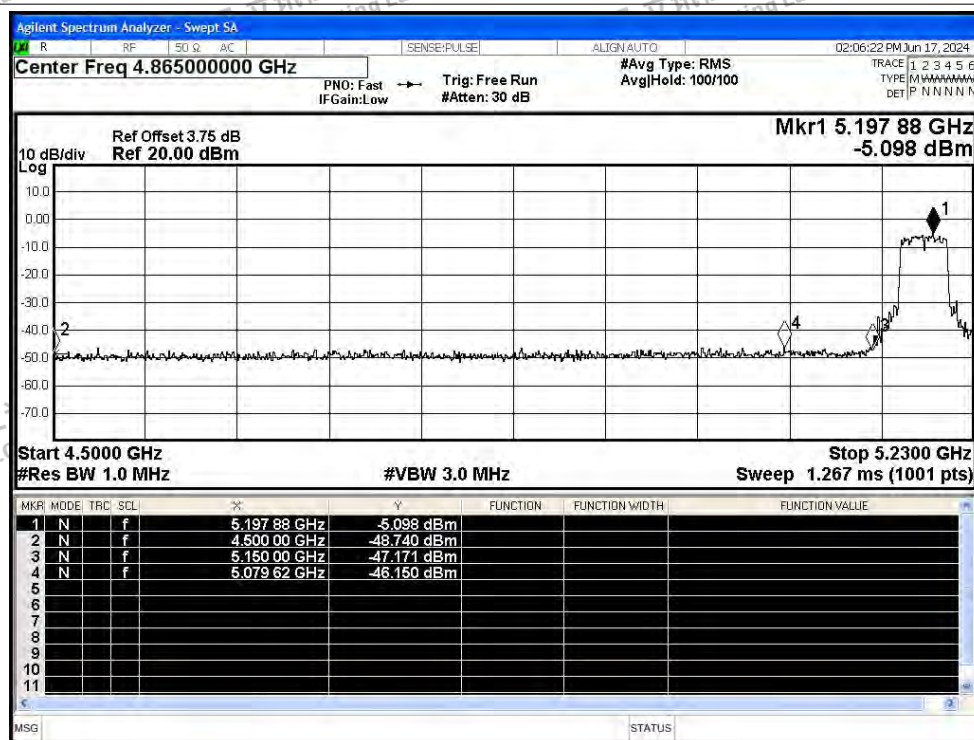

Restrict Band NVNT n40 5190MHz Ant1 Average

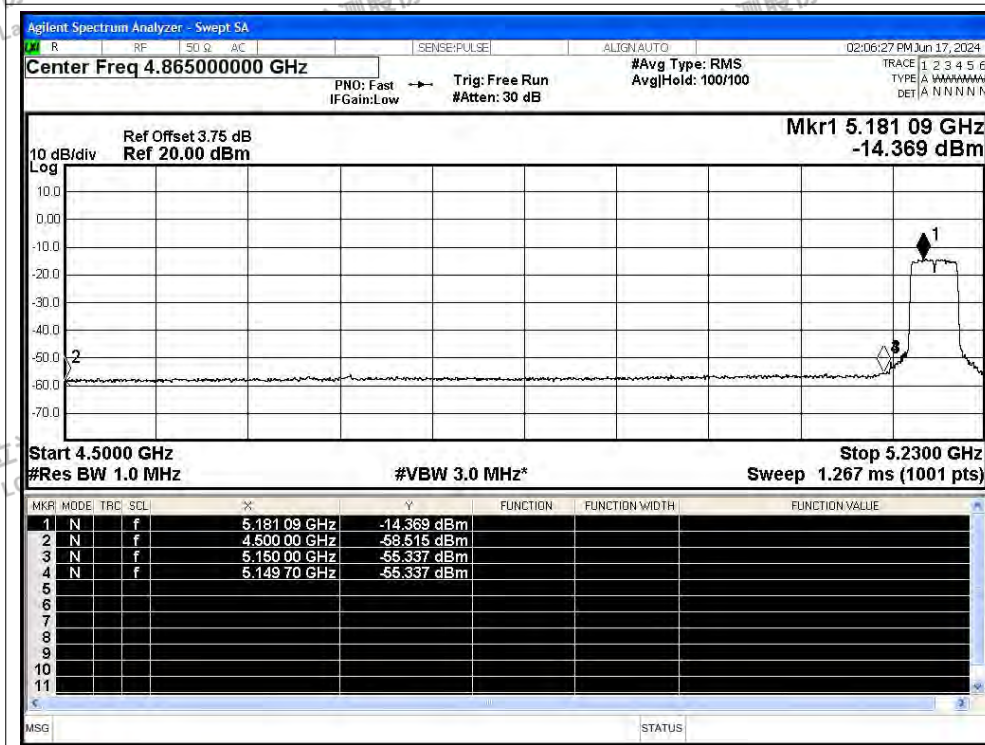

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

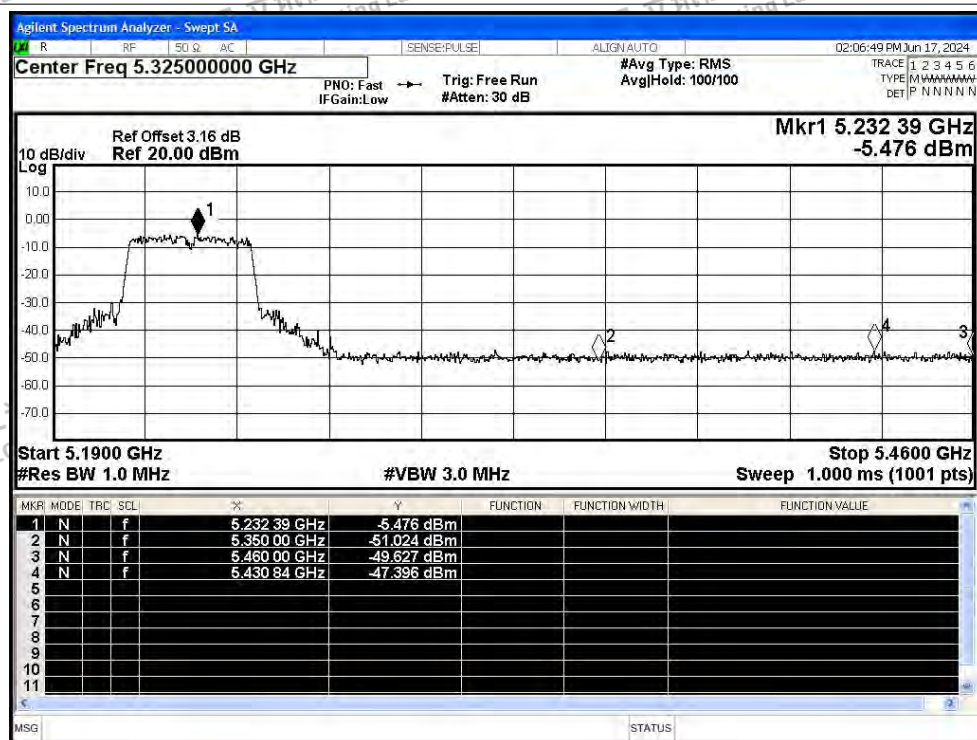

Restrict Band NVNT n40 5230MHz Ant1 Average

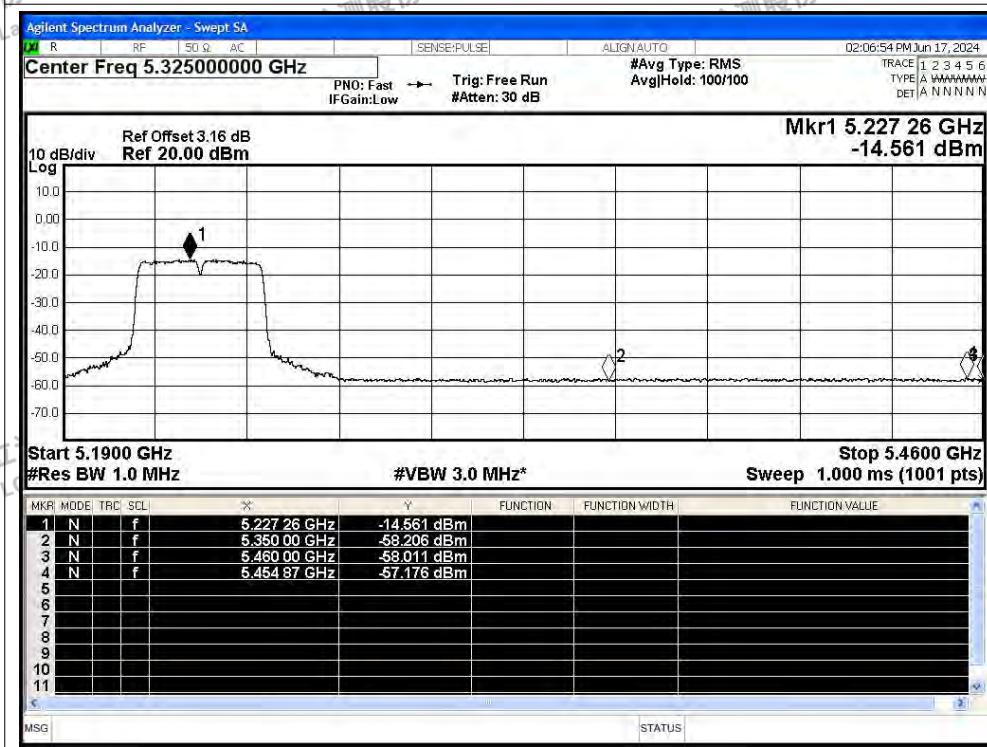

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

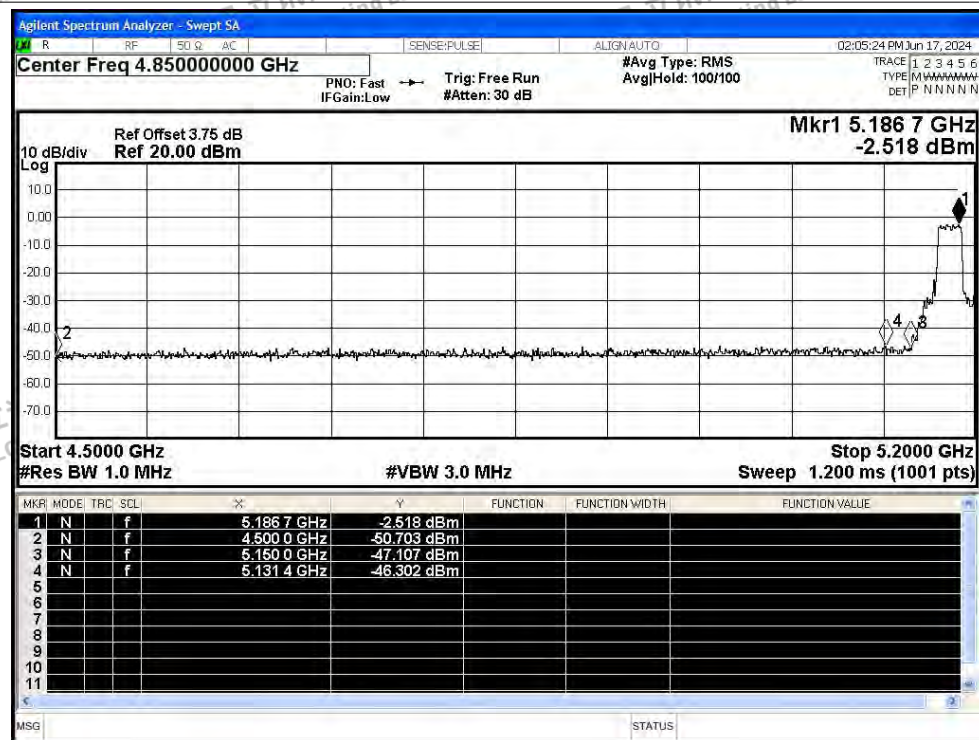

Restrict Band NVNT ac20 5180MHz Ant1 Average

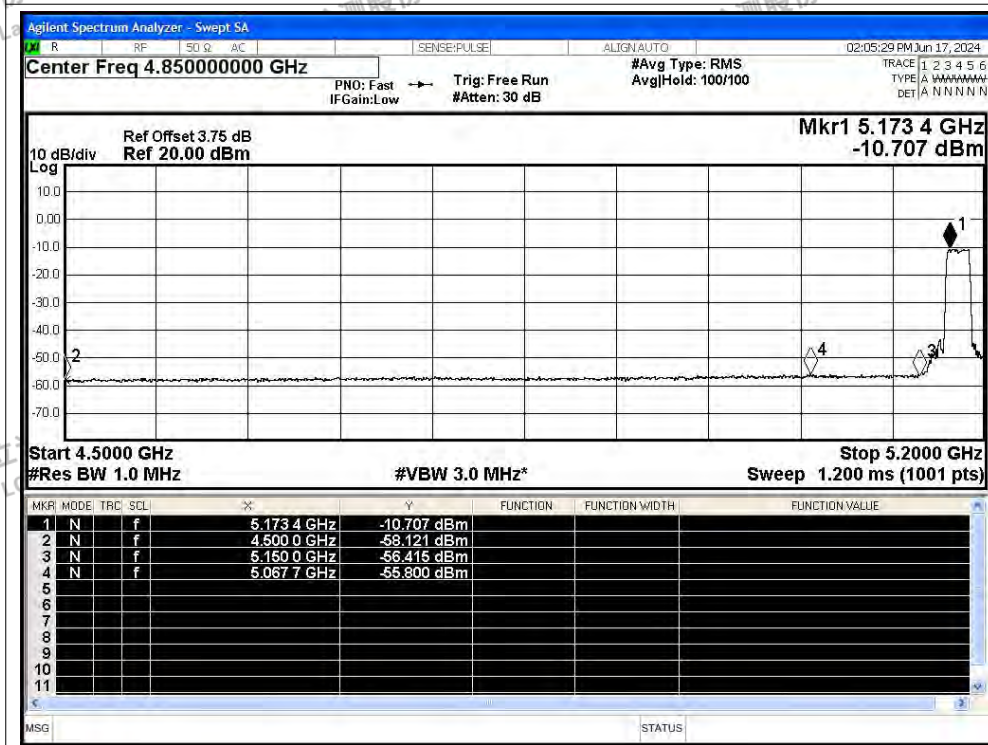

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

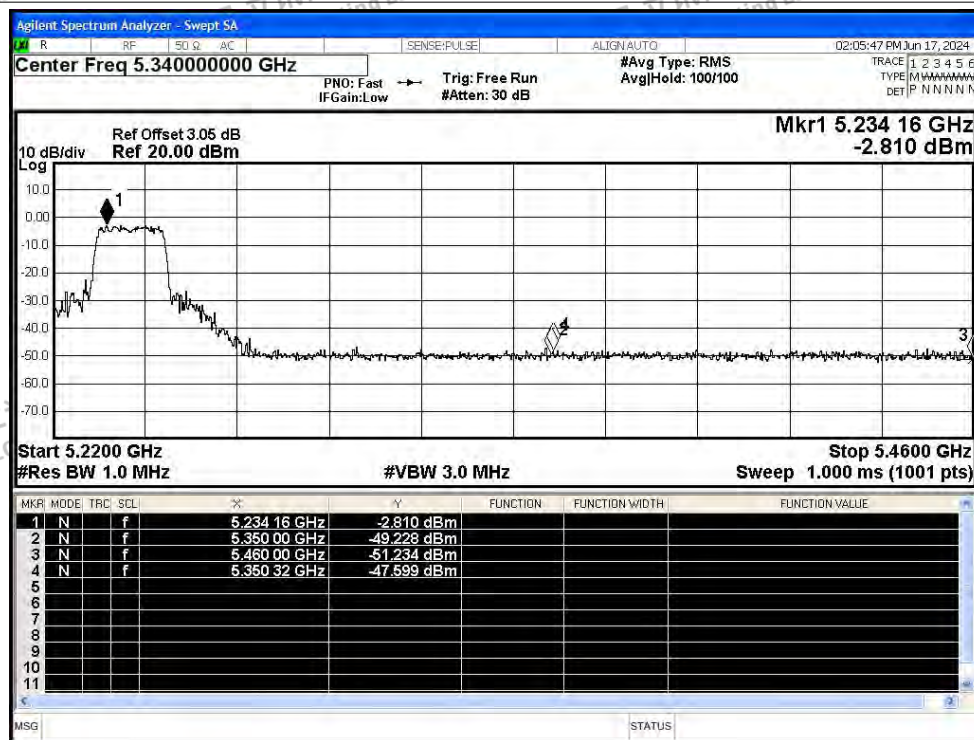

Restrict Band NVNT ac20 5240MHz Ant1 Average

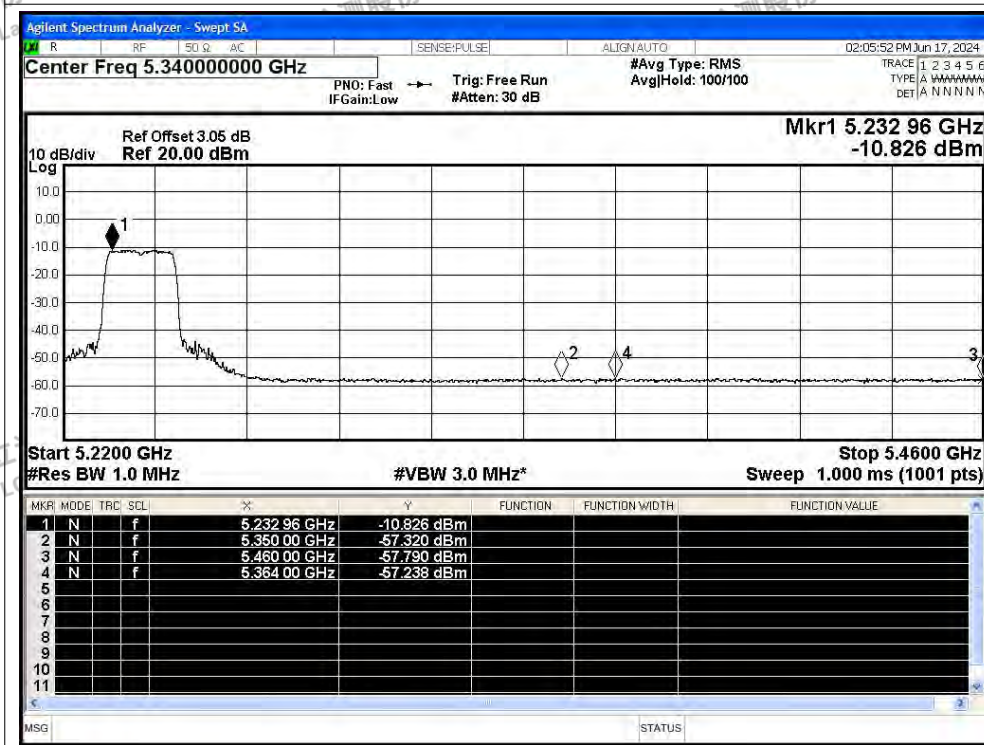

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

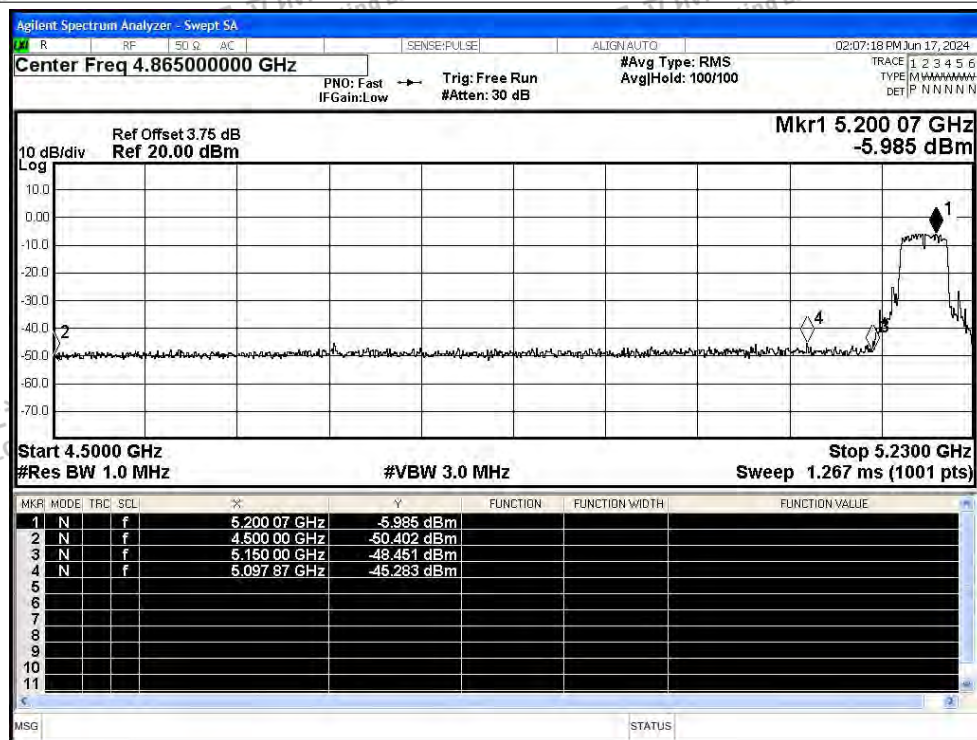

Restrict Band NVNT ac40 5190MHz Ant1 Average

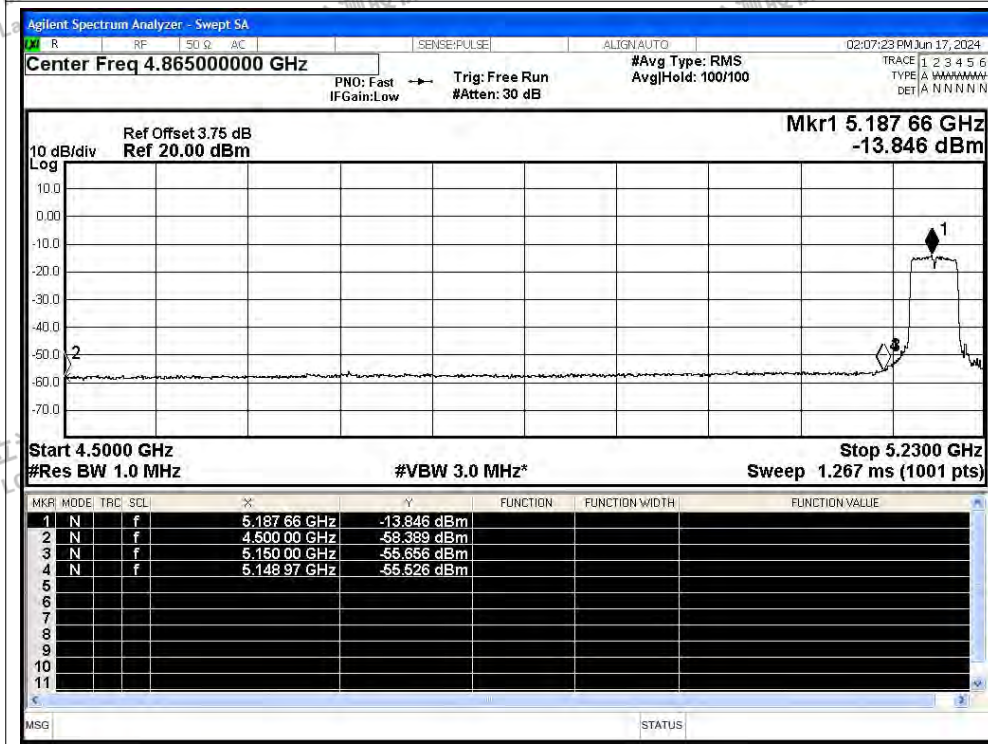

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak



Restrict Band NVNT ac40 5230MHz Ant1 Average

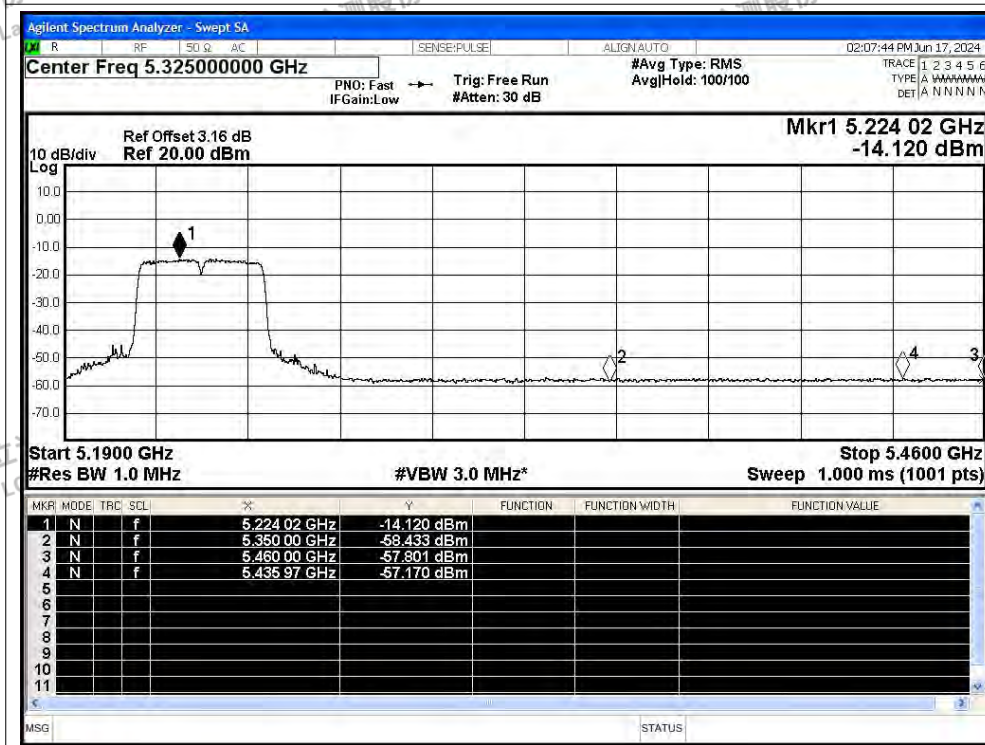

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

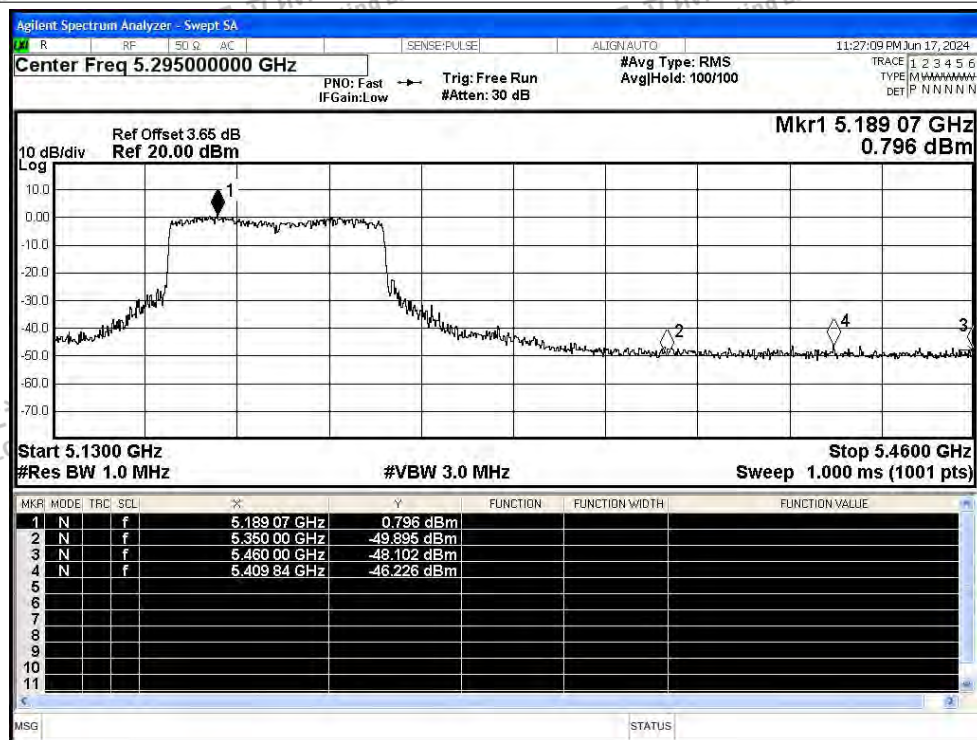

Restrict Band NVNT ac80 5210MHz Ant1 Average

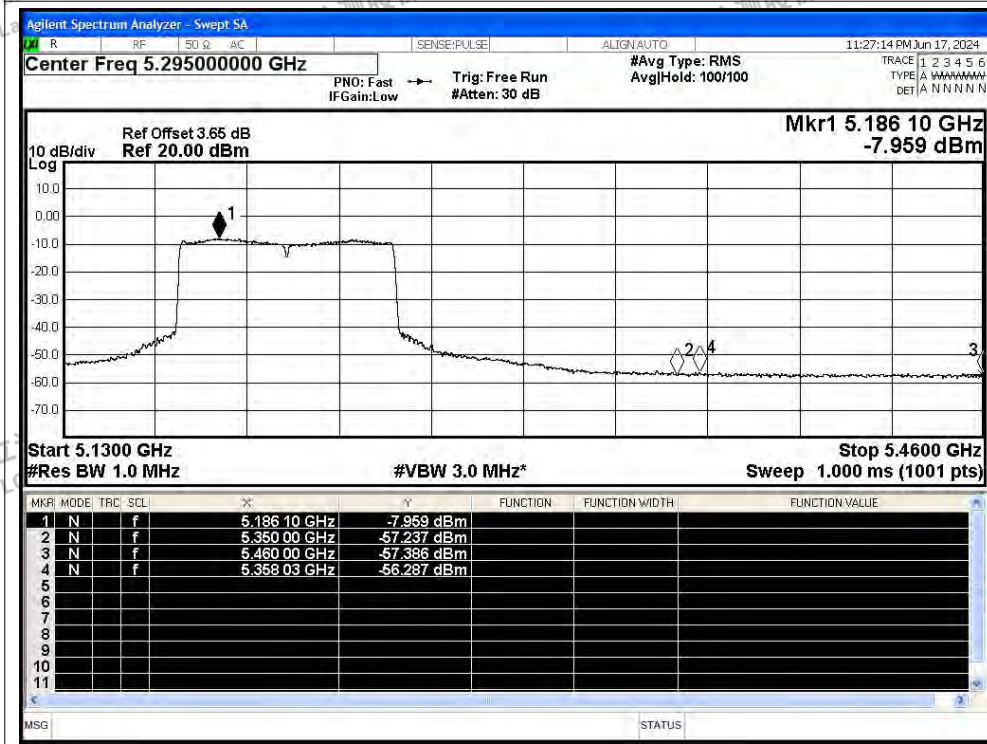

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

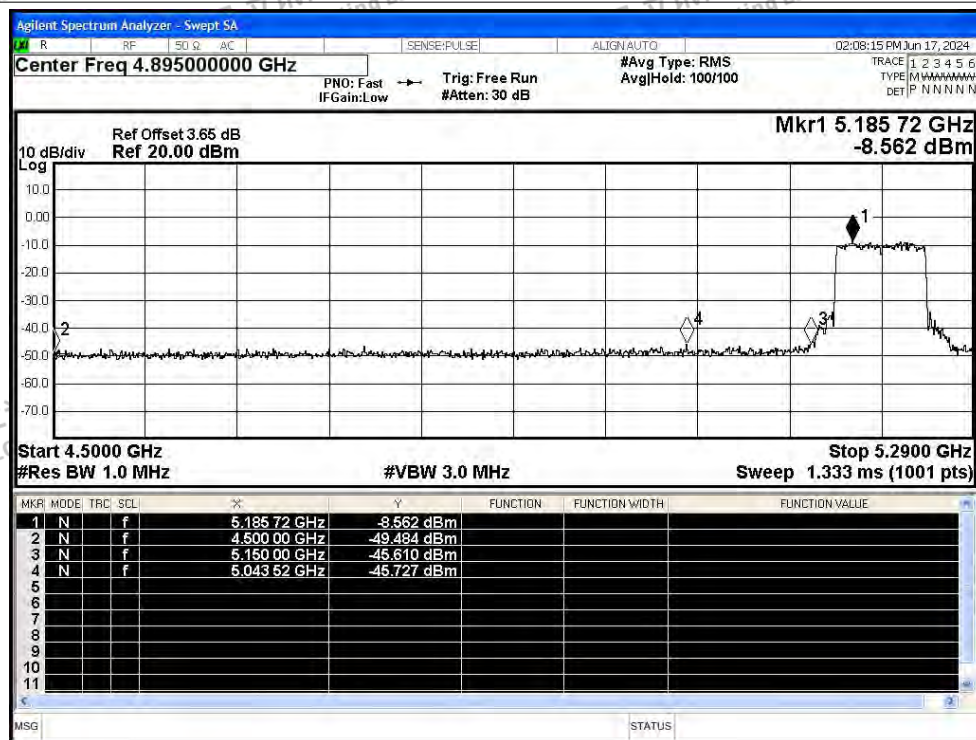

Restrict Band NVNT ac80 5210MHz Ant1 Average

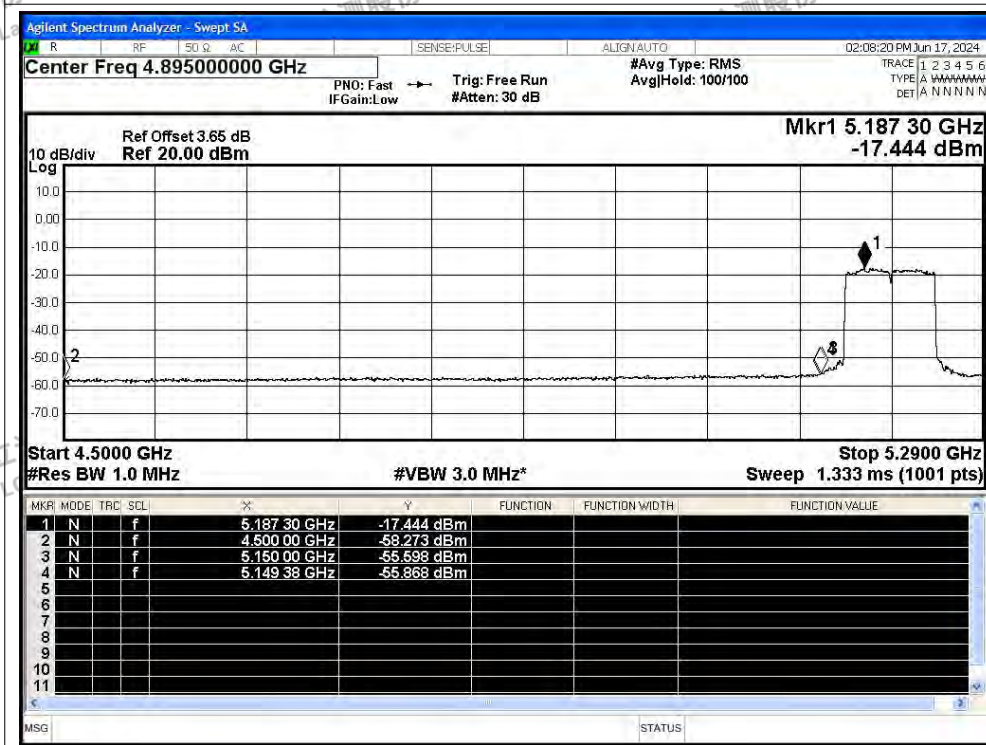

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5180MHz Ant1 Peak

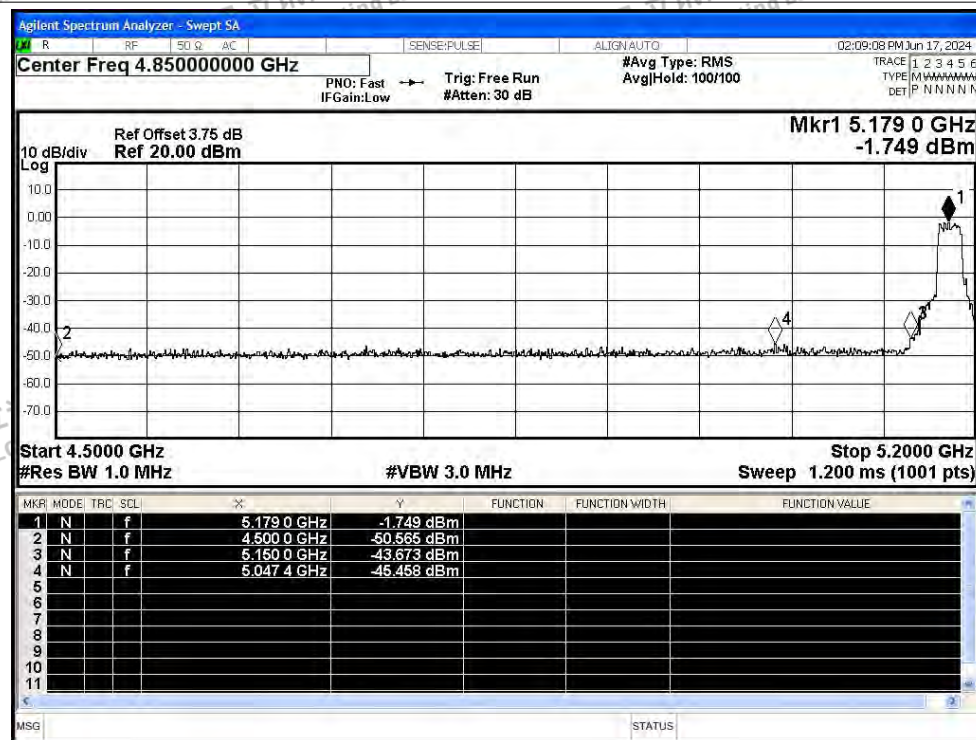

Restrict Band NVNT ax20 5180MHz Ant1 Average

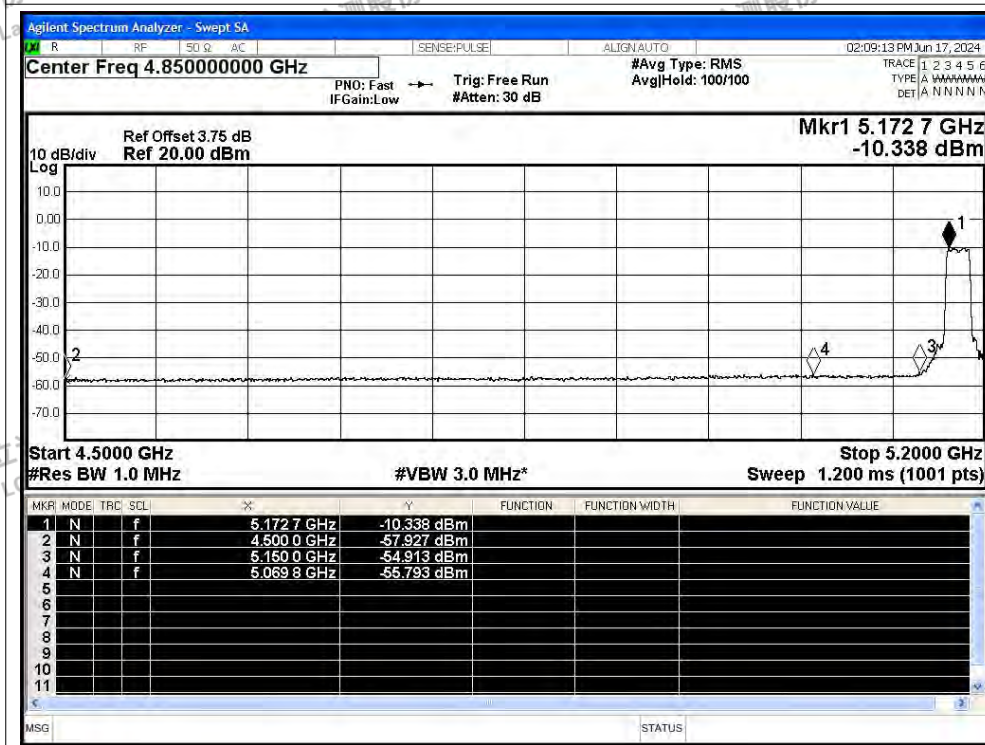

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5240MHz Ant1 Peak

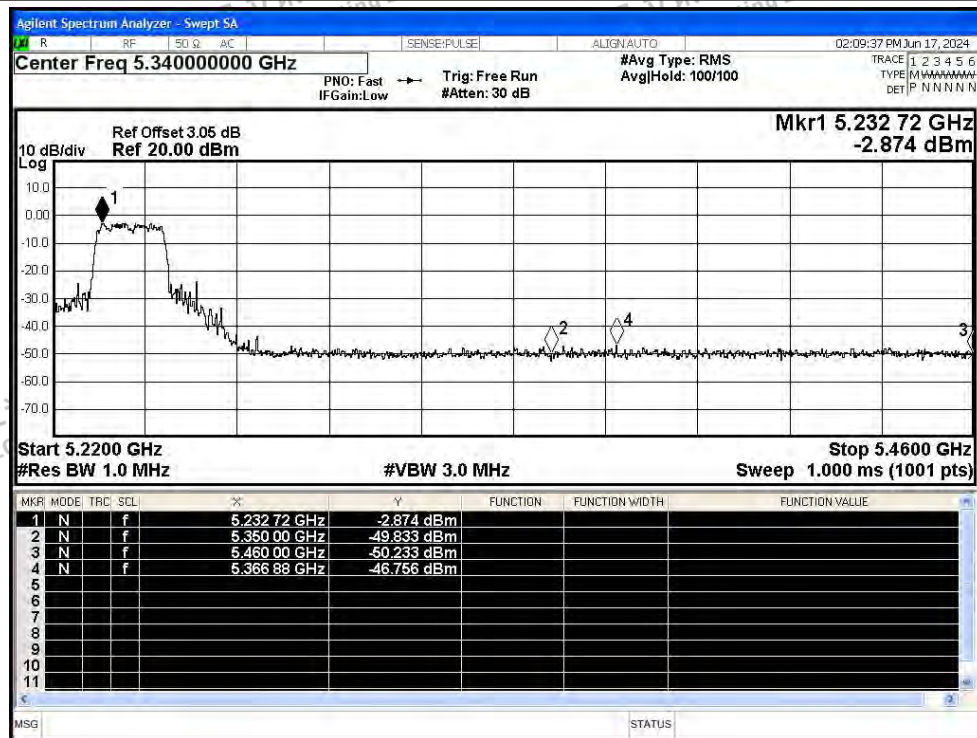

Restrict Band NVNT ax20 5240MHz Ant1 Average

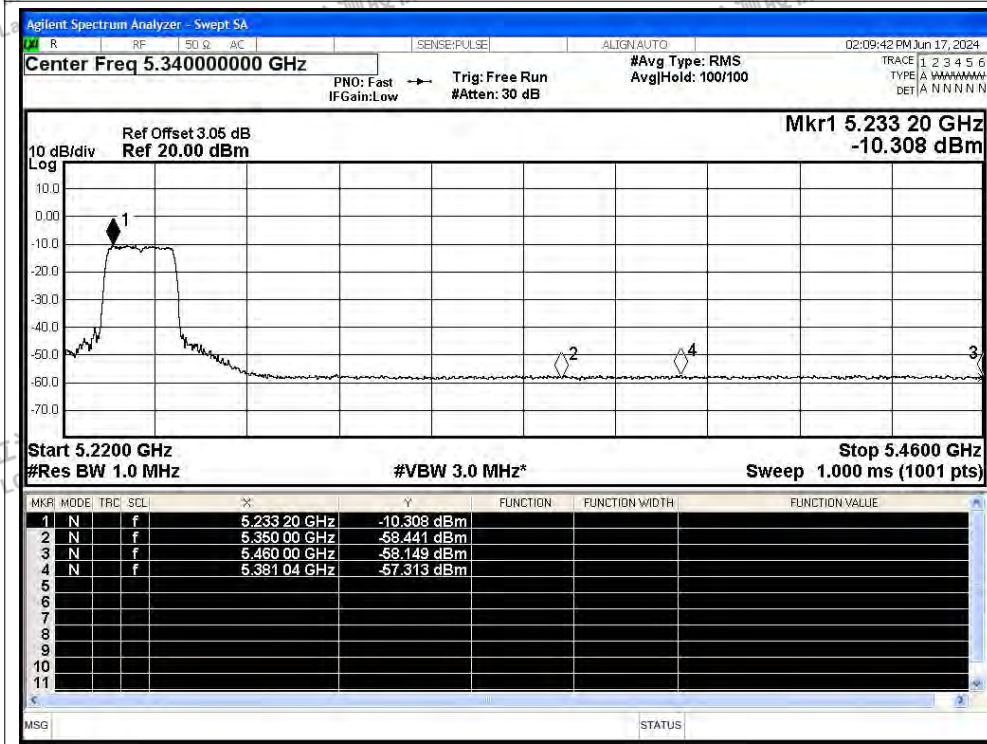

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5190MHz Ant1 Peak

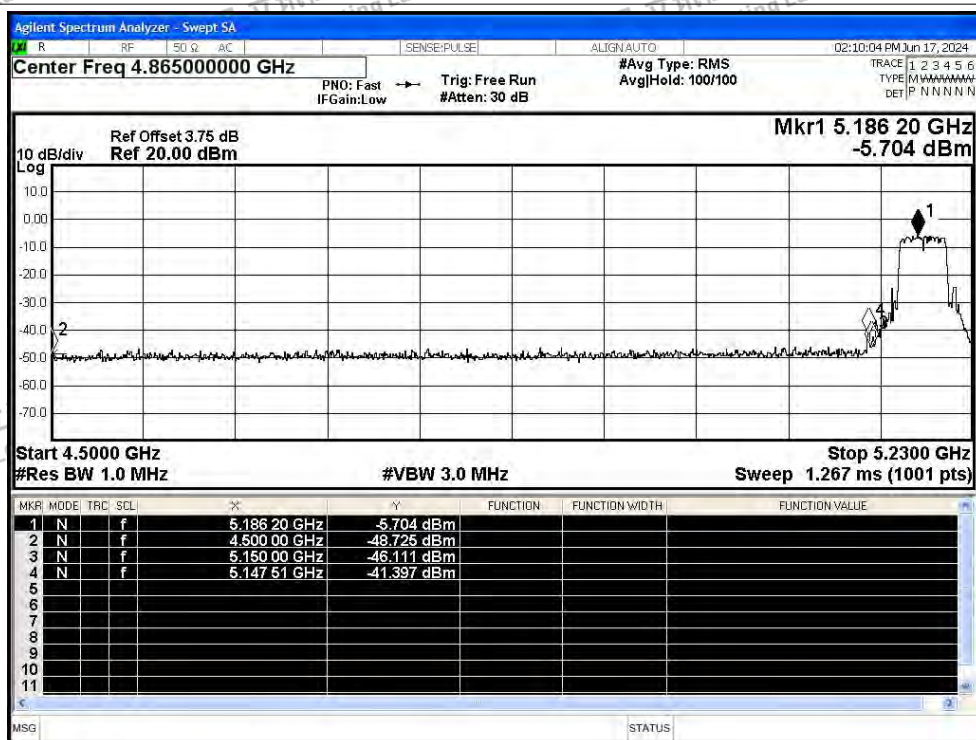

Restrict Band NVNT ax40 5190MHz Ant1 Average

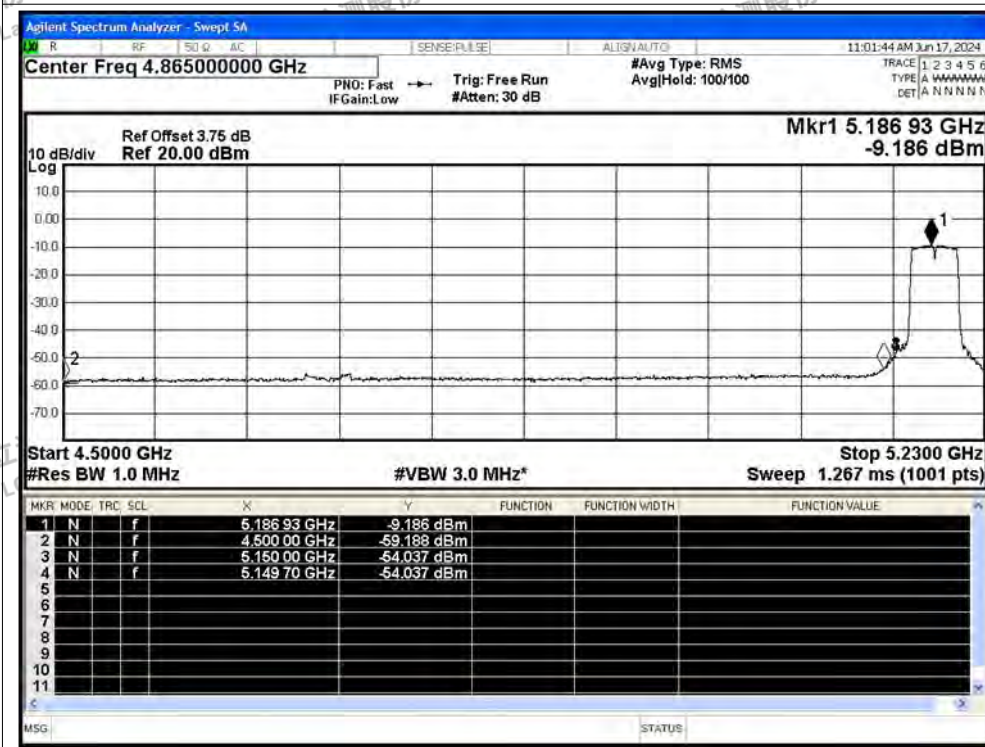

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5230MHz Ant1 Peak



Restrict Band NVNT ax40 5230MHz Ant1 Average

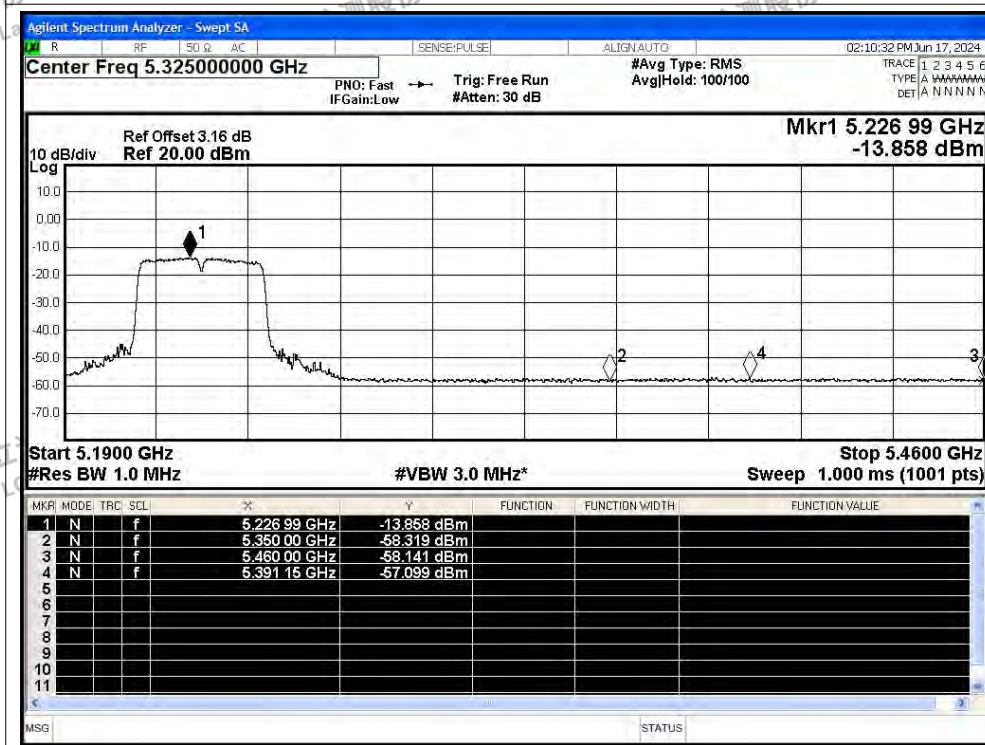

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

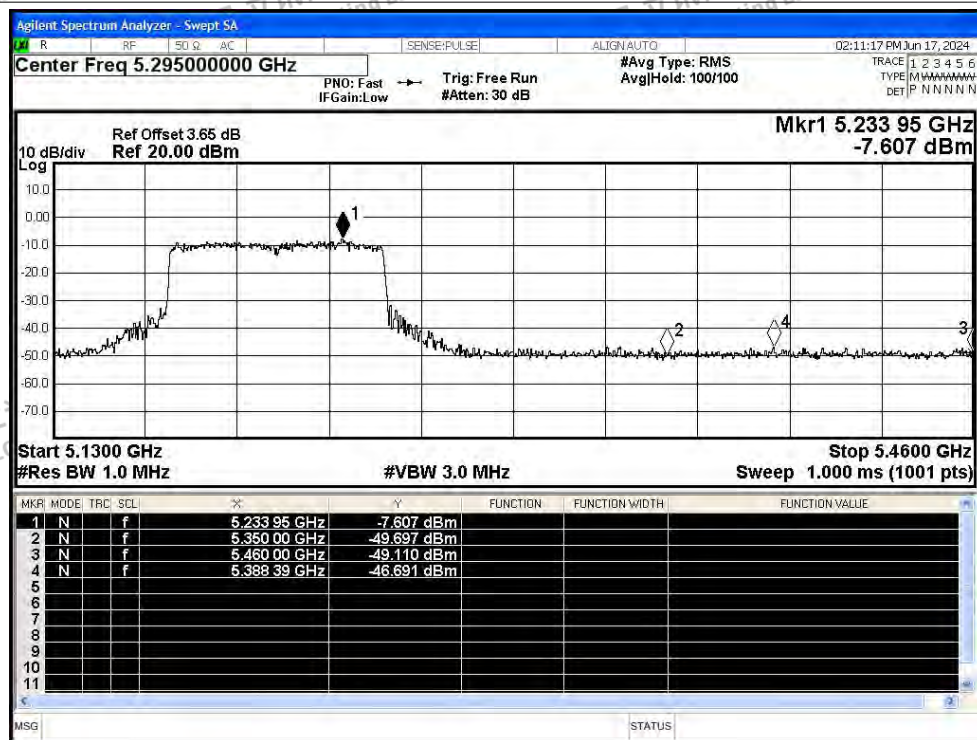

Restrict Band NVNT ax80 5210MHz Ant1 Average

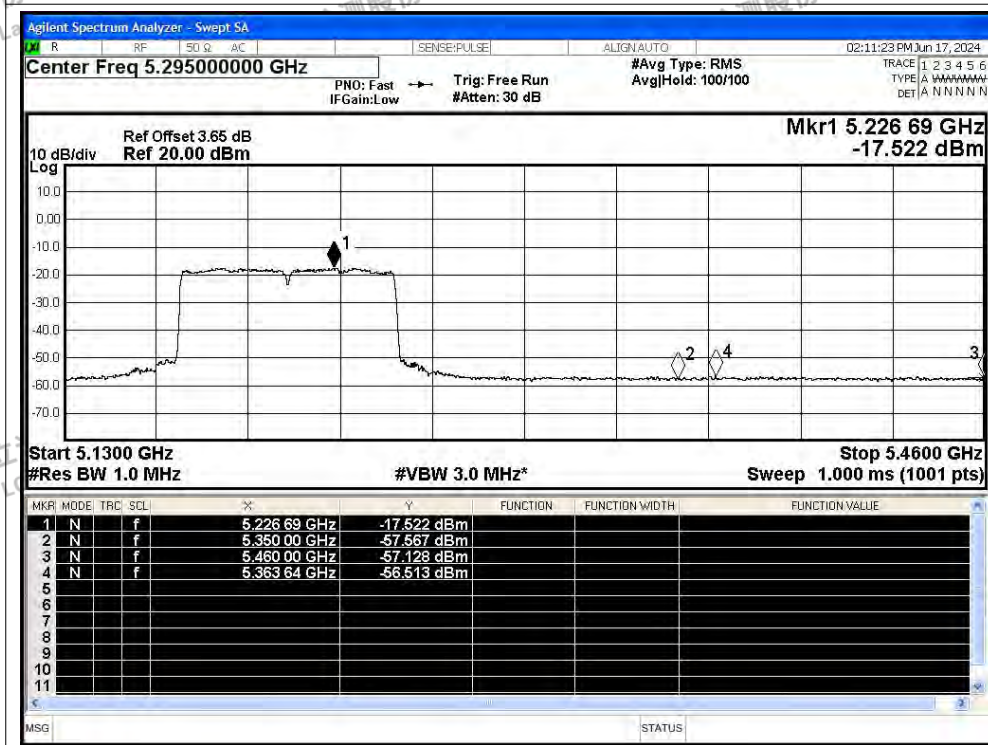

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5210MHz Ant1 Peak

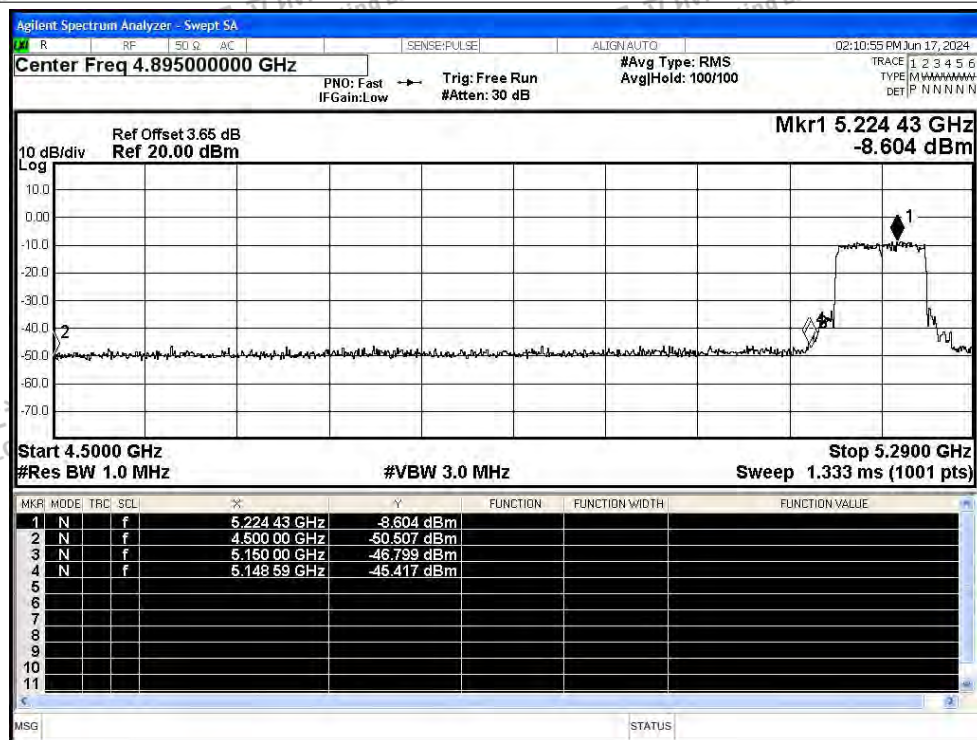

Restrict Band NVNT ax80 5210MHz Ant1 Average

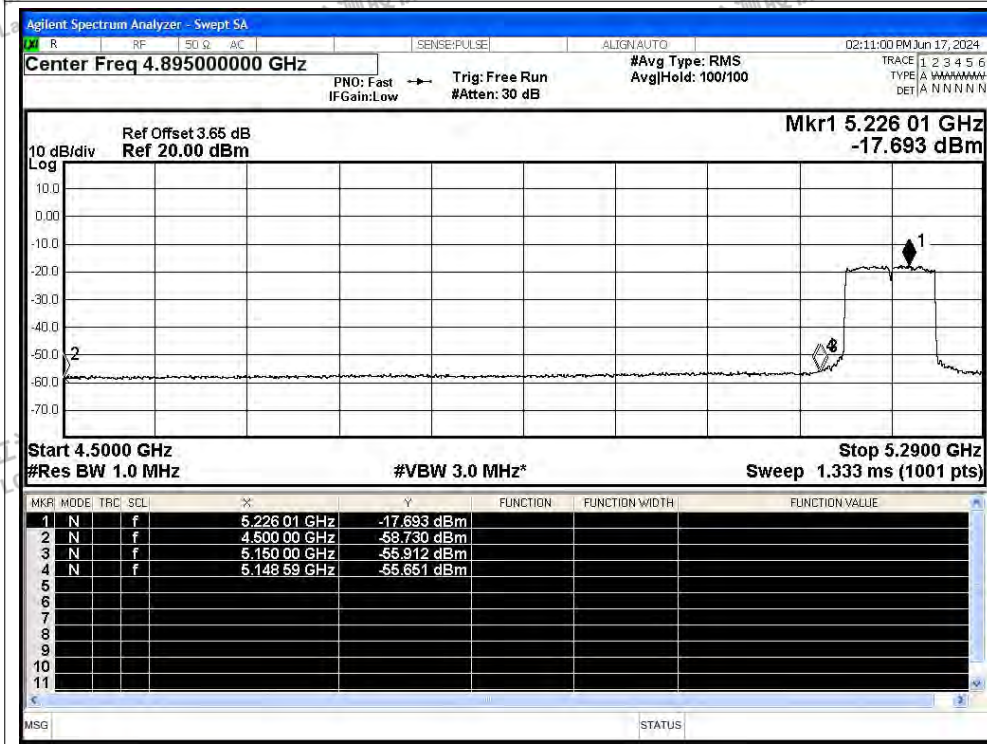

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Ant2+Ant3+Ant4:

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant2 Power (dBm)	Ant3 Power (dBm)	Ant4 Power (dBm)	Ant2+Ant3+Ant4	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-48.98	-48.98	-50.08	-44.55	8.36	59.07	Peak	68.2	Pass
NVNT	n20	5180	4500	-58.66	-58.4	-58.4	-53.71	8.36	49.91	Average	54	Pass
NVNT	n20	5180	5146.1	-43.77	-41.04	-43.52	-37.82	8.36	65.80	Peak	68.2	Pass
NVNT	n20	5180	5149.6	-54.88	-53.16	-55.86	-49.72	8.36	53.90	Average	54	Pass
NVNT	n20	5180	5150	-42.71	-37.99	-48.65	-36.46	8.36	67.16	Peak	68.2	Pass
NVNT	n20	5180	5150	-54.98	-52.65	-55.67	-50.46	8.36	53.16	Average	54	Pass
NVNT	n20	5240	5350	-51.19	-48.83	-49.99	-45.13	8.36	58.49	Peak	68.2	Pass
NVNT	n20	5240	5350	-57.58	-57.76	-58.32	-53.1	8.36	50.52	Average	54	Pass
NVNT	n20	5240	5427.6	-47.69	-47.23	-47.36	-42.65	8.36	60.97	Peak	68.2	Pass
NVNT	n20	5240	5421.36	-57.34	-56.84	-57.27	-52.37	8.36	51.25	Average	54	Pass
NVNT	n20	5240	5460	-50.82	-50.62	-50.24	-45.78	8.36	57.84	Peak	68.2	Pass
NVNT	n20	5240	5460	-58.36	-57.97	-57.58	-53.19	8.36	50.43	Average	54	Pass
NVNT	n40	5190	4500	-50.63	-50.98	-48.74	-45.23	8.36	58.39	Peak	68.2	Pass
NVNT	n40	5190	4500	-58.46	-58.84	-58.52	-53.83	8.36	49.79	Average	54	Pass
NVNT	n40	5190	5147.51	-41.35	-37.32	-46.15	-35.48	8.36	68.14	Peak	68.2	Pass
NVNT	n40	5190	5148.97	-53.16	-54.48	-55.34	-50.46	8.36	53.16	Average	54	Pass
NVNT	n40	5190	5150	-43.62	-40.57	-47.17	-38.23	8.36	65.39	Peak	68.2	Pass
NVNT	n40	5190	5150	-53.67	-54.48	-55.34	-49.67	8.36	53.95	Average	54	Pass
NVNT	n40	5230	5350	-48.84	-49.87	-51.02	-45.05	8.36	58.57	Peak	68.2	Pass
NVNT	n40	5230	5350	-57.75	-57.36	-58.21	-52.99	8.36	50.63	Average	54	Pass
NVNT	n40	5230	5411.13	-46.66	-46.89	-47.4	-42.2	8.36	61.42	Peak	68.2	Pass
NVNT	n40	5230	5394.39	-57.16	-56.91	-57.18	-52.31	8.36	51.31	Average	54	Pass
NVNT	n40	5230	5460	-48.9	-51.12	-49.63	-45.02	8.36	58.60	Peak	68.2	Pass
NVNT	n40	5230	5460	-57.75	-58.24	-58.01	-53.22	8.36	50.40	Average	54	Pass
NVNT	ac20	5180	4500	-50.44	-50.05	-50.7	-45.62	8.36	58.00	Peak	68.2	Pass
NVNT	ac20	5180	4500	-58.11	-58.47	-58.12	-53.46	8.36	50.16	Average	54	Pass
NVNT	ac20	5180	5148.2	-37.41	-39.75	-46.3	-36.07	8.36	67.55	Peak	68.2	Pass
NVNT	ac20	5180	5149.6	-54.73	-52.39	-55.8	-50.29	8.36	53.33	Average	54	Pass
NVNT	ac20	5180	5150	-38.13	-43.31	-47.11	-36.58	8.36	67.04	Peak	68.2	Pass
NVNT	ac20	5180	5150	-53.97	-51.3	-56.42	-49.63	8.36	53.99	Average	54	Pass
NVNT	ac20	5240	5350	-50.35	-49.61	-49.23	-44.93	8.36	58.69	Peak	68.2	Pass
NVNT	ac20	5240	5350	-57.89	-57.61	-57.32	-52.83	8.36	50.79	Average	54	Pass
NVNT	ac20	5240	5396.88	-47.03	-47.2	-47.6	-42.5	8.36	61.12	Peak	68.2	Pass
NVNT	ac20	5240	5376.96	-57.28	-57.11	-57.24	-52.44	8.36	51.18	Average	54	Pass
NVNT	ac20	5240	5460	-50.48	-48.72	-51.23	-45.24	8.36	58.38	Peak	68.2	Pass
NVNT	ac20	5240	5460	-58.03	-58.03	-57.79	-53.18	8.36	50.44	Average	54	Pass
NVNT	ac40	5190	4500	-51.24	-49.88	-50.4	-45.7	8.36	57.92	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	-58.21	-58.31	-58.39	-53.53	8.36	50.09	Average	54	Pass
NVNT	ac40	5190	5147.51	-39.19	-42.06	-45.28	-36.73	8.36	66.89	Peak	68.2	Pass
NVNT	ac40	5190	5149.7	-52.99	-54.63	-55.53	-49.89	8.36	53.73	Average	54	Pass
NVNT	ac40	5190	5150	-40.6	-46.55	-48.45	-39.08	8.36	64.54	Peak	68.2	Pass
NVNT	ac40	5190	5150	-52.99	-54.63	-55.66	-49.89	8.36	53.73	Average	54	Pass
NVNT	ac40	5230	5350	-50.04	-49.15	-50.39	-45.06	8.36	58.56	Peak	68.2	Pass
NVNT	ac40	5230	5350	-57.94	-57.84	-58.43	-53.29	8.36	50.33	Average	54	Pass
NVNT	ac40	5230	5400.6	-46.35	-47.25	-46.91	-42.05	8.36	61.57	Peak	68.2	Pass
NVNT	ac40	5230	5359.56	-57.18	-57.09	-57.17	-52.38	8.36	51.24	Average	54	Pass
NVNT	ac40	5230	5460	-51.13	-50.27	-50.11	-45.71	8.36	57.91	Peak	68.2	Pass
NVNT	ac40	5230	5460	-58.58	-58.28	-57.8	-53.44	8.36	50.18	Average	54	Pass
NVNT	ac80	5210	5350	-45.67	-48.24	-49.9	-42.81	8.36	60.81	Peak	68.2	Pass
NVNT	ac80	5210	5350	-55.35	-56.68	-57.24	-51.58	8.36	52.04	Average	54	Pass
NVNT	ac80	5210	5350.11	-45.67	-46.59	-46.23	-41.38	8.36	62.24	Peak	68.2	Pass
NVNT	ac80	5210	5354.07	-55.28	-56.41	-56.29	-51.19	8.36	52.43	Average	54	Pass
NVNT	ac80	5210	5460	-50.48	-50.46	-48.1	-44.76	8.36	58.86	Peak	68.2	Pass
NVNT	ac80	5210	5460	-57.84	-57.67	-57.39	-52.86	8.36	50.76	Average	54	Pass
NVNT	ac80	5210	4500	-49.67	-49.52	-49.48	-44.78	8.36	58.84	Peak	68.2	Pass
NVNT	ac80	5210	4500	-58.85	-58.3	-58.27	-53.69	8.36	49.93	Average	54	Pass
NVNT	ac80	5210	5147.8	-34.67	-37.93	-45.73	-35.77	8.36	67.85	Peak	68.2	Pass
NVNT	ac80	5210	5144.64	-46.86	-52.64	-55.87	-49.63	8.36	53.99	Average	54	Pass
NVNT	ac80	5210	5150	-38.77	-43.55	-45.61	-36.86	8.36	66.76	Peak	68.2	Pass
NVNT	ac80	5210	5150	-47.67	-52.65	-55.6	-49.67	8.36	53.95	Average	54	Pass
NVNT	ax20	5180	4500	-49.83	-51.72	-50.57	-45.87	8.36	57.75	Peak	68.2	Pass
NVNT	ax20	5180	4500	-58.26	-58.5	-57.93	-53.45	8.36	50.17	Average	54	Pass
NVNT	ax20	5180	5148.9	-39.62	-40.34	-45.46	-36.38	8.36	67.24	Peak	68.2	Pass
NVNT	ax20	5180	5149.6	-53.55	-52.2	-55.79	-49.89	8.36	53.73	Average	54	Pass
NVNT	ax20	5180	5150	-43.7	-41.56	-43.67	-38.08	8.36	65.54	Peak	68.2	Pass
NVNT	ax20	5180	5150	-53.76	-52.13	-54.91	-49.75	8.36	53.87	Average	54	Pass
NVNT	ax20	5240	5350	-48.54	-48.86	-49.83	-44.27	8.36	59.35	Peak	68.2	Pass
NVNT	ax20	5240	5350	-57.62	-57.8	-58.44	-53.17	8.36	50.45	Average	54	Pass
NVNT	ax20	5240	5356.56	-46.97	-47.18	-46.76	-42.2	8.36	61.42	Peak	68.2	Pass
NVNT	ax20	5240	5451.84	-57.17	-57.06	-57.31	-52.41	8.36	51.21	Average	54	Pass
NVNT	ax20	5240	5460	-49.43	-48.62	-50.23	-44.61	8.36	59.01	Peak	68.2	Pass
NVNT	ax20	5240	5460	-58.01	-58.08	-58.15	-53.31	8.36	50.31	Average	54	Pass
NVNT	ax40	5190	4500	-49.39	-52.42	-48.73	-45.14	8.36	58.48	Peak	68.2	Pass
NVNT	ax40	5190	4500	-58.15	-58.71	-58.06	-53.53	8.36	50.09	Average	54	Pass
NVNT	ax40	5190	4764.99	-45.5	-34.93	-41.4	-35.75	8.36	67.87	Peak	68.2	Pass
NVNT	ax40	5190	4766.45	-56.28	-51.67	-59.88	-49.92	8.36	53.7	Average	54	Pass
NVNT	ax40	5190	5150	-48.82	-37.13	-46.11	-36.36	8.36	67.26	Peak	68.2	Pass
NVNT	ax40	5190	5150	-56.68	-50.67	-54.04	-49.70	8.36	53.92	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5230	5350	-50.66	-49.64	-50.7	-45.53	8.36	58.09	Peak	68.2	Pass
NVNT	ax40	5230	5350	-57.72	-57.36	-58.32	-53.01	8.36	50.61	Average	54	Pass
NVNT	ax40	5230	5374.68	-47.72	-47.09	-47.27	-42.58	8.36	61.04	Peak	68.2	Pass
NVNT	ax40	5230	5380.89	-56.98	-57.01	-57.1	-52.26	8.36	51.36	Average	54	Pass
NVNT	ax40	5230	5460	-50.27	-49.02	-49.5	-44.8	8.36	58.82	Peak	68.2	Pass
NVNT	ax40	5230	5460	-58.61	-58.04	-58.14	-53.49	8.36	50.13	Average	54	Pass
NVNT	ax80	5210	5350	-47.34	-49.05	-49.7	-43.81	8.36	59.81	Peak	68.2	Pass
NVNT	ax80	5210	5350	-56.95	-56.78	-57.57	-52.32	8.36	51.30	Average	54	Pass
NVNT	ax80	5210	5420.07	-46.82	-46.77	-46.69	-41.99	8.36	61.63	Peak	68.2	Pass
NVNT	ax80	5210	5353.74	-55.92	-56.2	-56.51	-51.43	8.36	52.19	Average	54	Pass
NVNT	ax80	5210	5460	-48.75	-48.59	-49.11	-44.04	8.36	59.58	Peak	68.2	Pass
NVNT	ax80	5210	5460	-57.74	-57.77	-57.13	-52.77	8.36	50.85	Average	54	Pass
NVNT	ax80	5210	4500	-51.28	-50	-50.51	-45.79	8.36	57.83	Peak	68.2	Pass
NVNT	ax80	5210	4500	-58.05	-58.47	-58.73	-53.64	8.36	49.98	Average	54	Pass
NVNT	ax80	5210	5138.32	-43.85	-38.53	-45.42	-36.77	8.36	66.85	Peak	68.2	Pass
NVNT	ax80	5210	5149.38	-53.56	-52.63	-55.65	-49.63	8.36	53.99	Average	54	Pass
NVNT	ax80	5210	5150	-44.49	-43.43	-46.8	-39.92	8.36	63.70	Peak	68.2	Pass
NVNT	ax80	5210	5150	-54.28	-52.4	-55.91	-49.69	8.36	53.93	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	ac20	5180	Ant2	5180	0	0	25	Pass
NVNT	ac20	5200	Ant2	5200	0	0	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT ac20 5180MHz Ant2

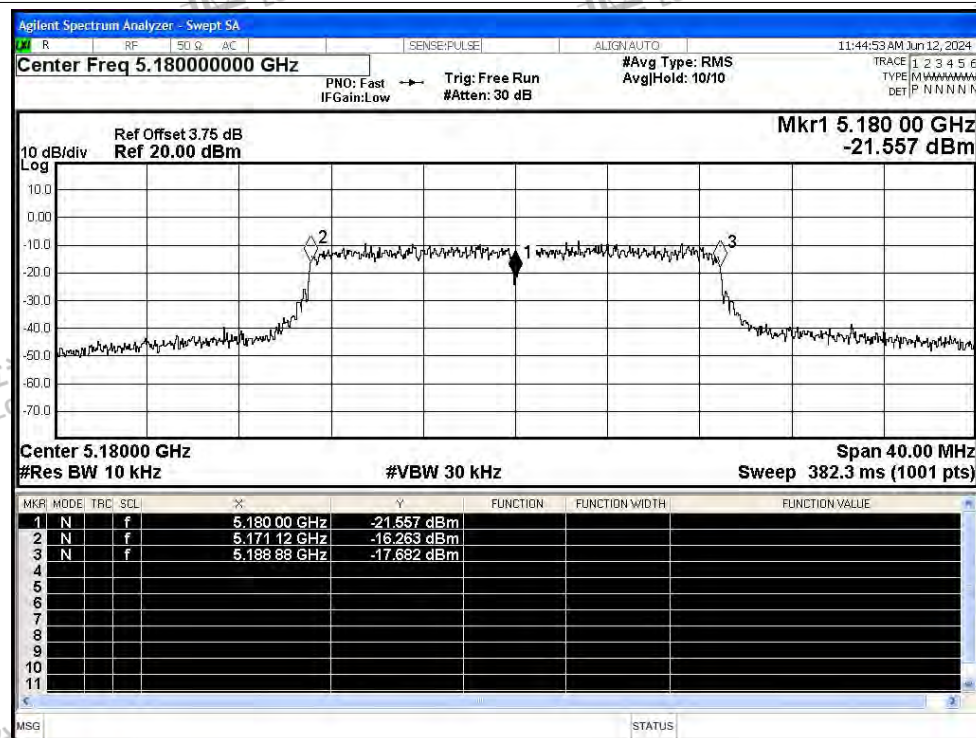

Freq. Stability NVNT ac20 5200MHz Ant2

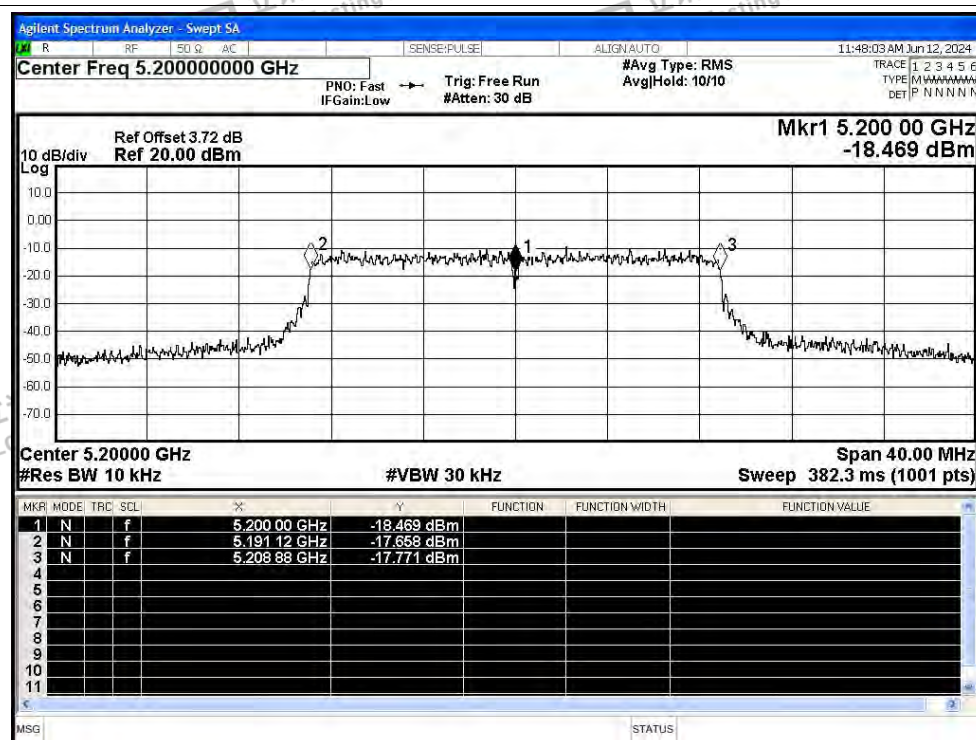

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5190MHz Ant2

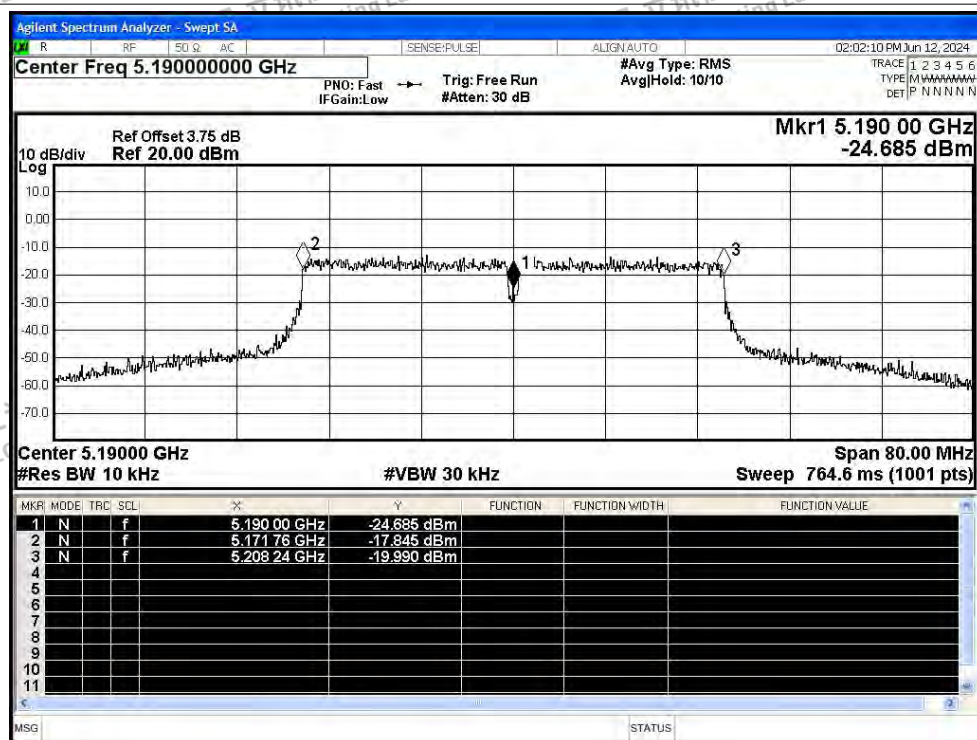

Freq. Stability NVNT ac40 5230MHz Ant2

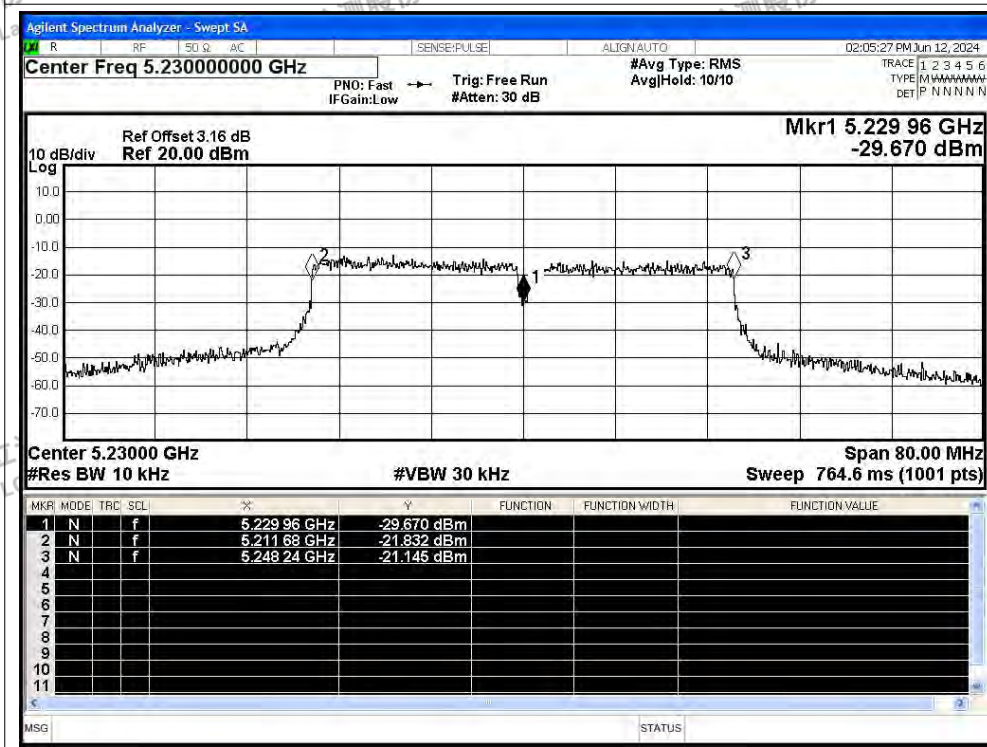

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Freq. Stability NVNT ac80 5210MHz Ant2

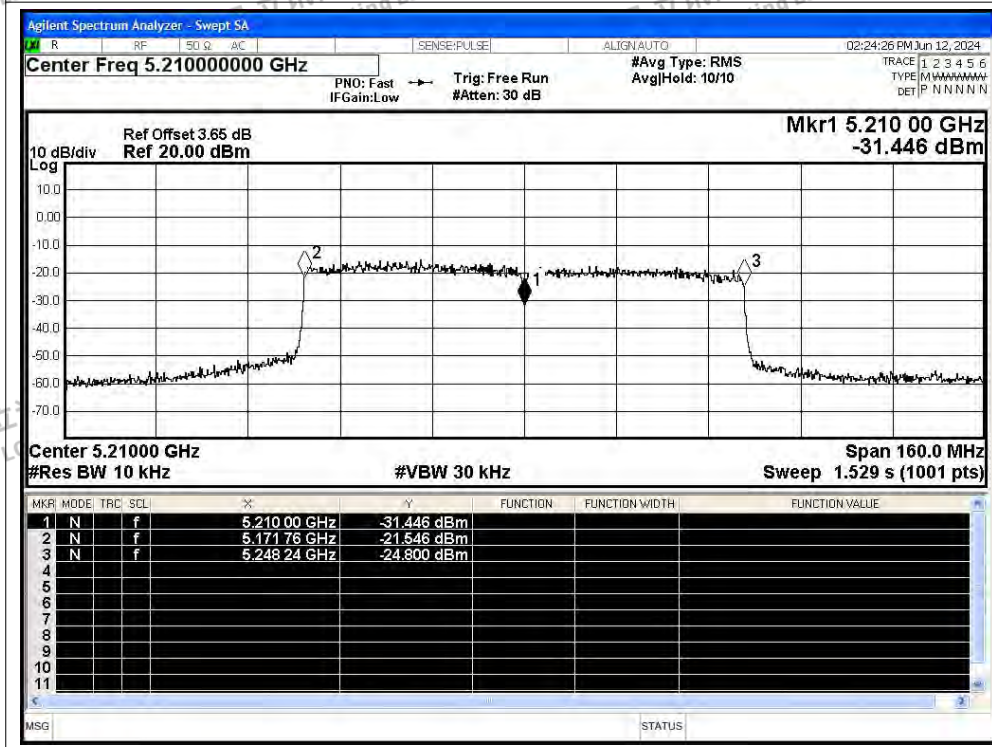

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant3	5200	0	0	25	Pass
NVNT	a	5240	Ant3	5240	0	0	25	Pass
NVNT	n20	5180	Ant3	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant3	5200	0	0	25	Pass
NVNT	n20	5240	Ant3	5240	0	0	25	Pass
NVNT	n40	5190	Ant3	5190	0	0	25	Pass
NVNT	n40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac20	5180	Ant3	5180	0	0	25	Pass
NVNT	ac20	5200	Ant3	5200	0	0	25	Pass
NVNT	ac20	5240	Ant3	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant3	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant3	5230	0	0	25	Pass
NVNT	ac80	5210	Ant3	5210	0	0	25	Pass
NVNT	ax20	5180	Ant3	5180	0	0	25	Pass
NVNT	ax20	5200	Ant3	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant3	5240	0	0	25	Pass
NVNT	ax40	5190	Ant3	5190	0	0	25	Pass
NVNT	ax40	5230	Ant3	5229.96	-40000	-7.65	25	Pass
NVNT	ax80	5210	Ant3	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant3

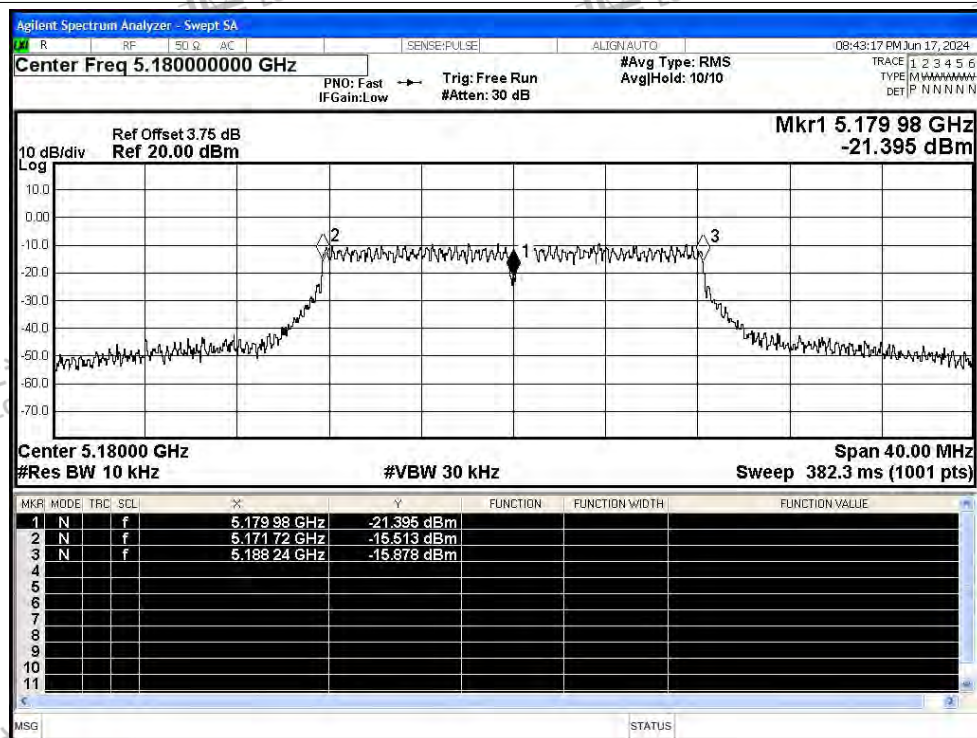

Freq. Stability NVNT a 5200MHz Ant3

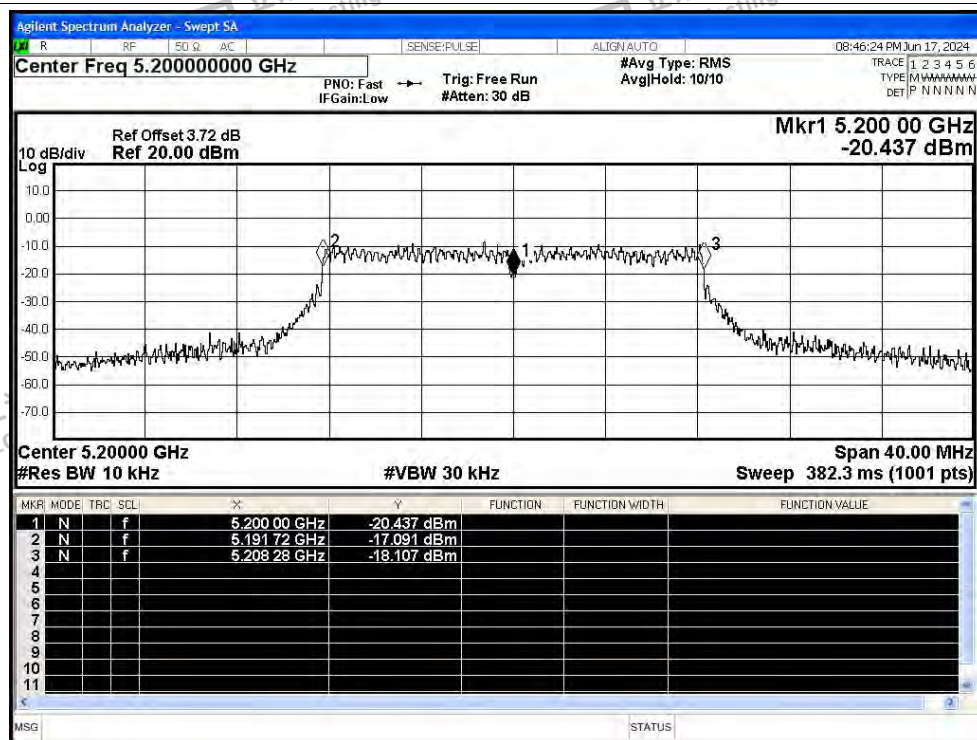

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant3

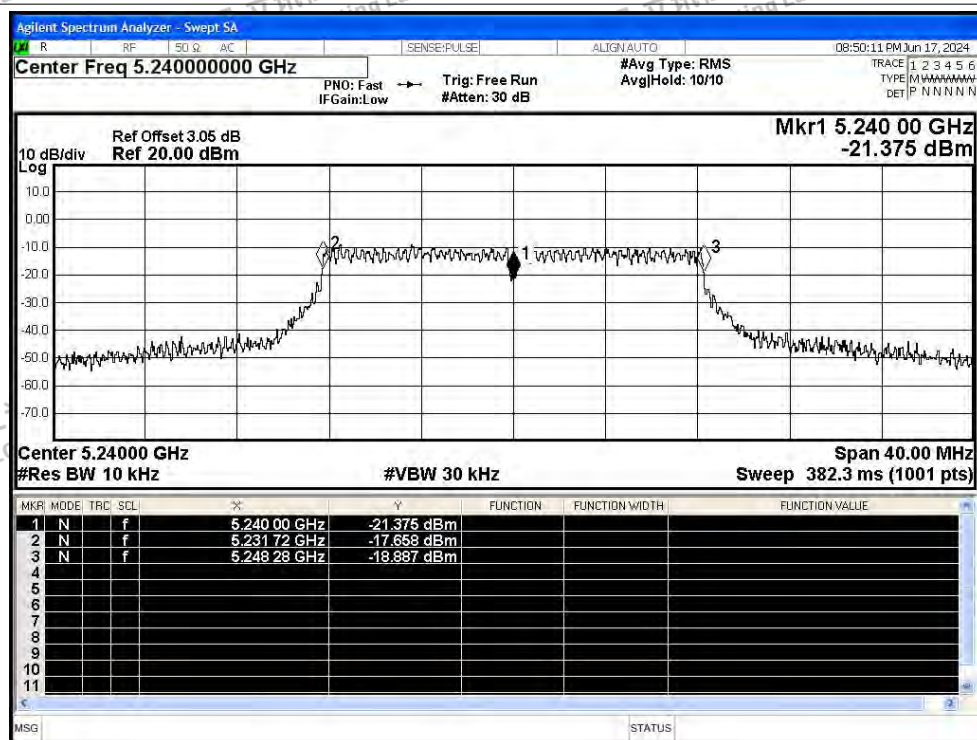

Freq. Stability NVNT n20 5180MHz Ant3

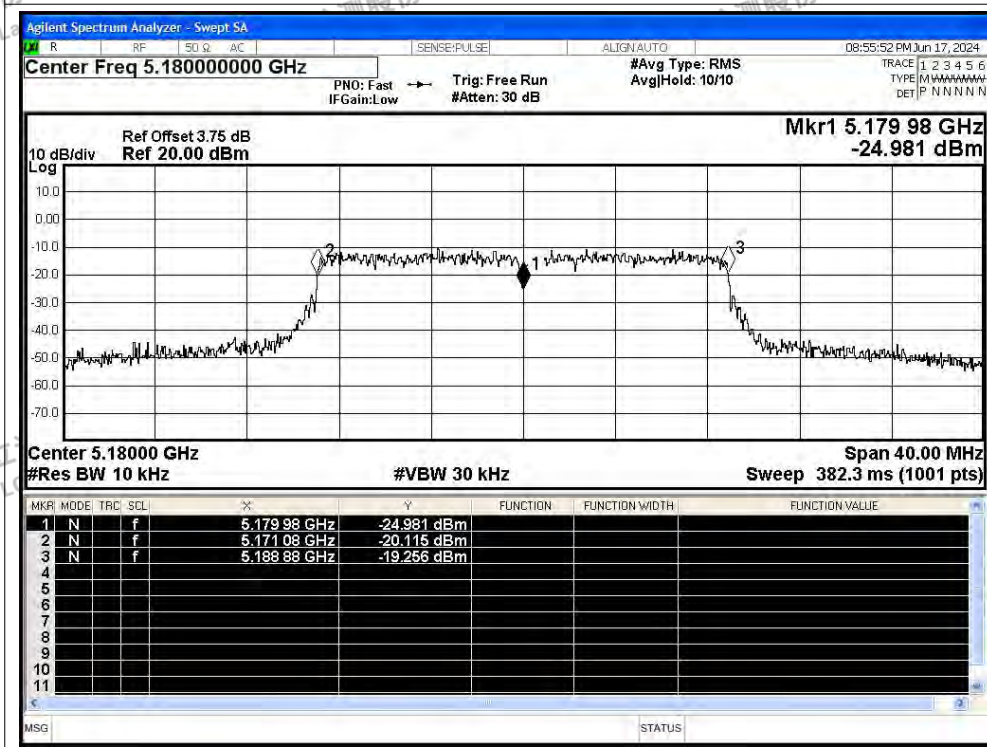

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant3

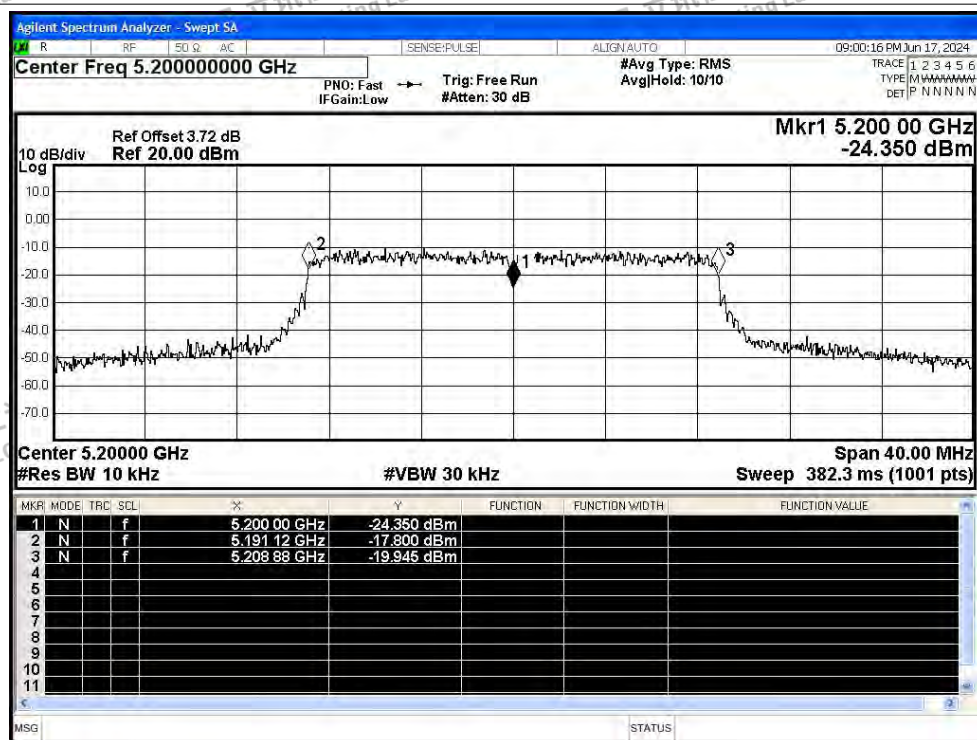

Freq. Stability NVNT n20 5240MHz Ant3

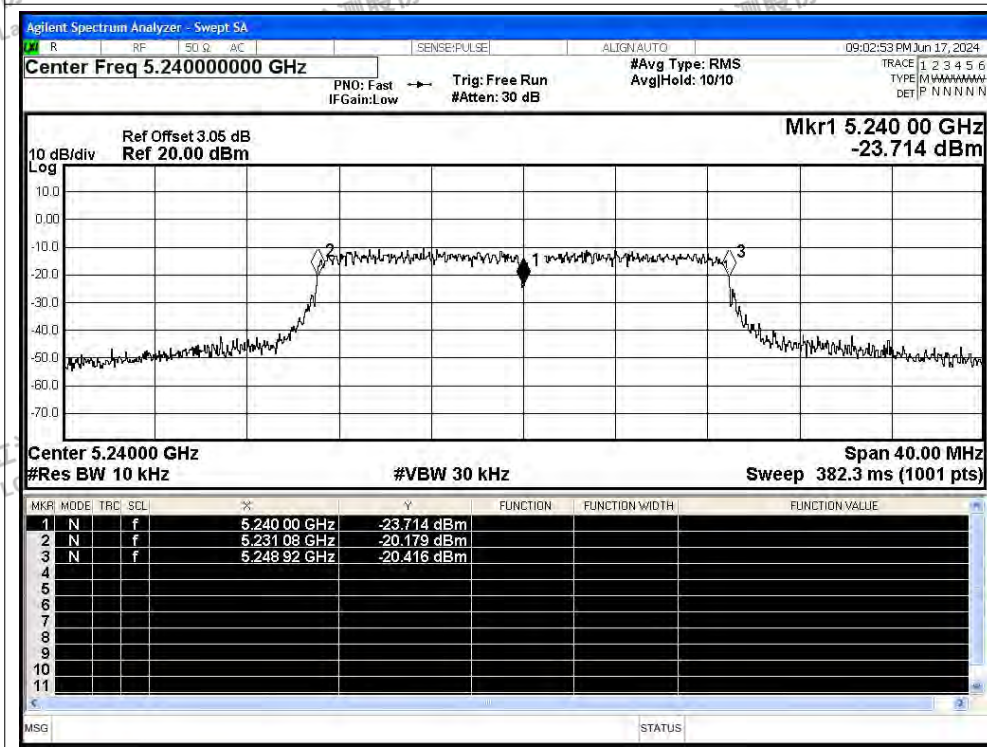

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant3

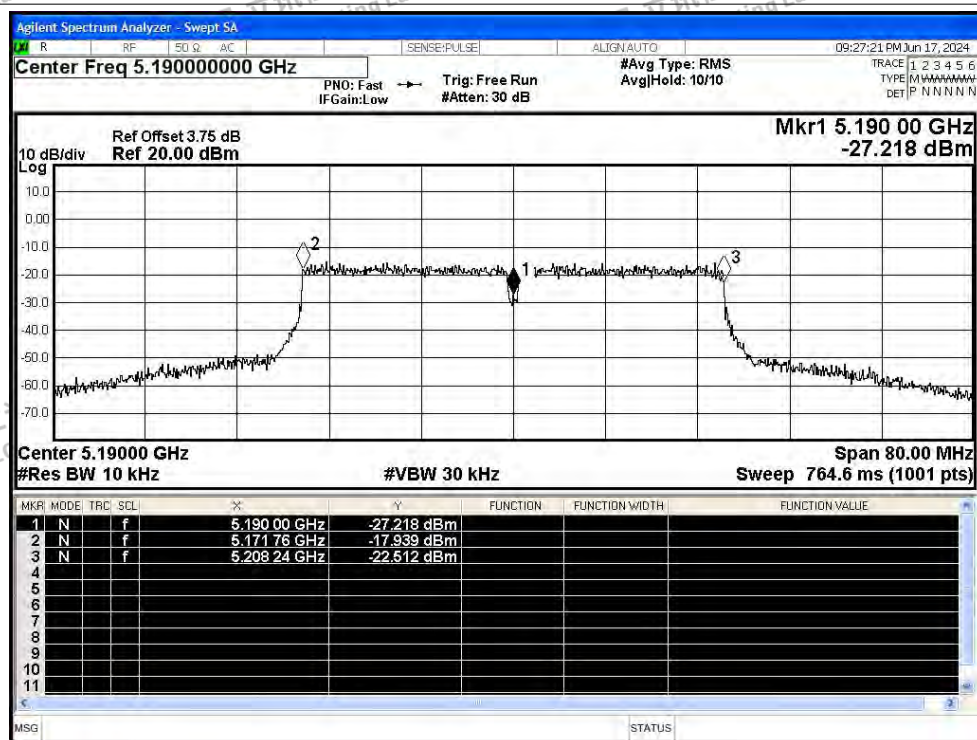

Freq. Stability NVNT n40 5230MHz Ant3

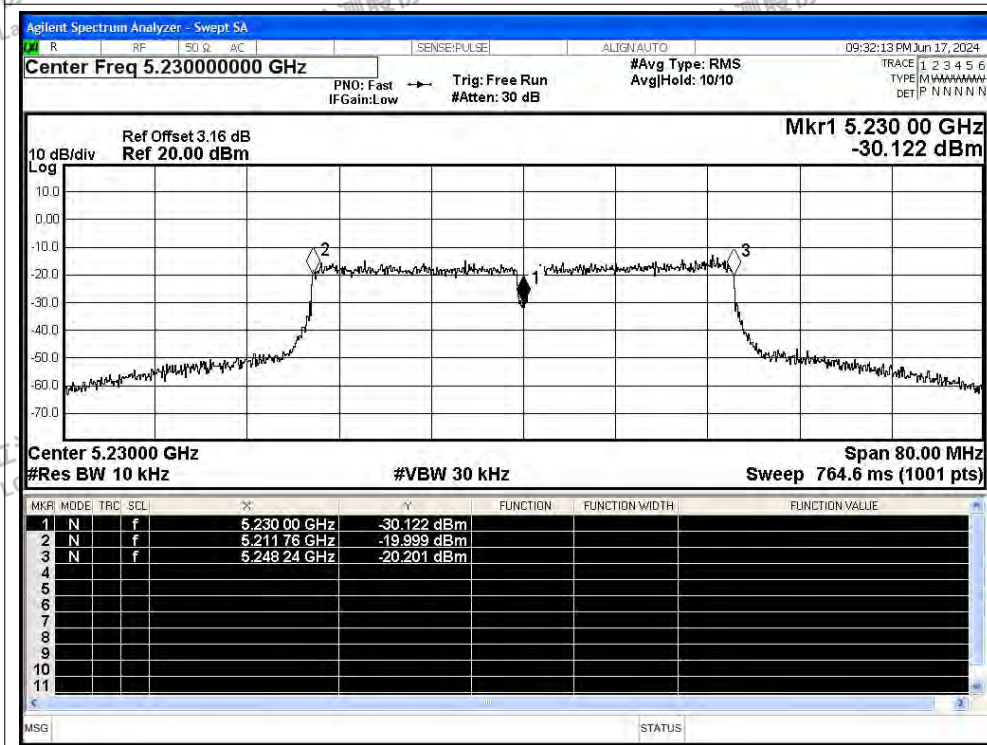

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant3

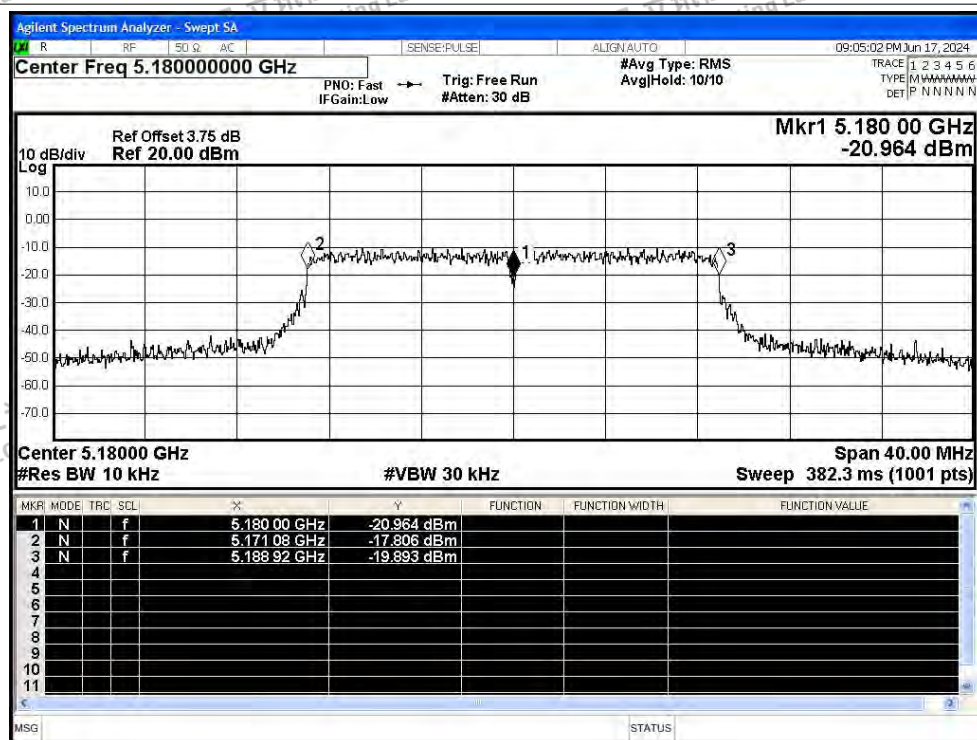

Freq. Stability NVNT ac20 5200MHz Ant3

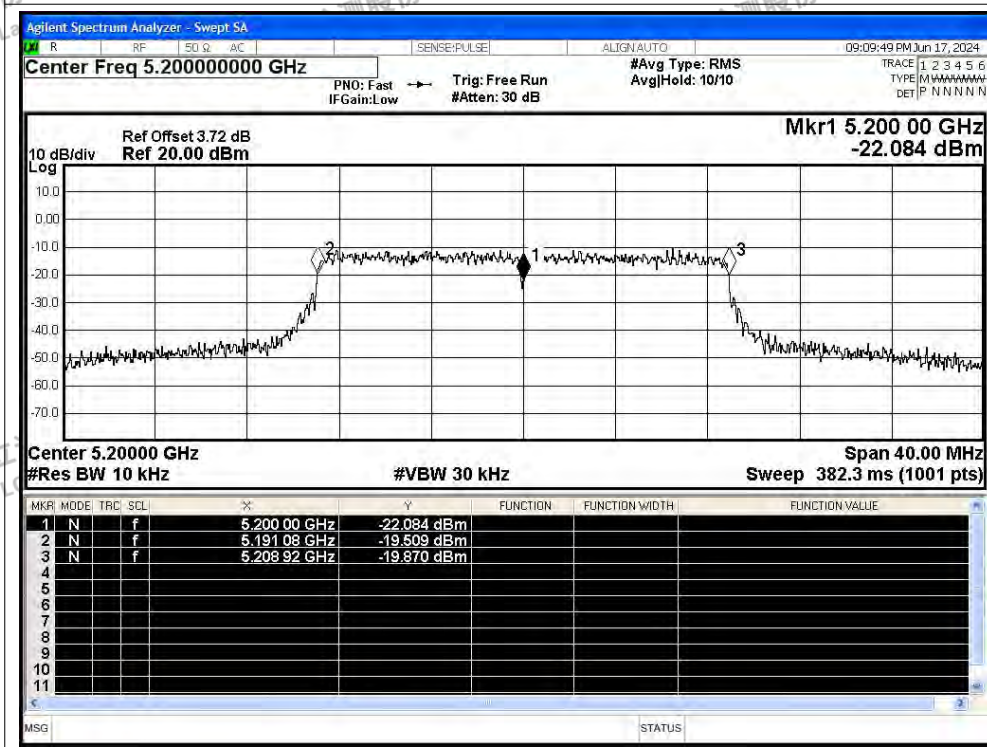

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant3

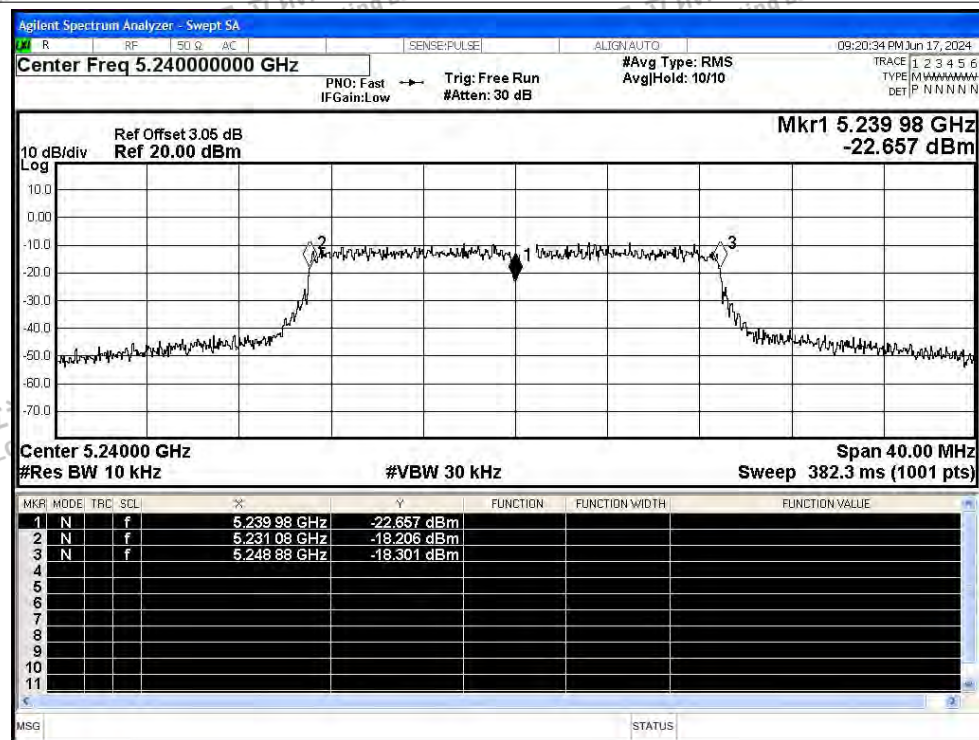

Freq. Stability NVNT ac40 5190MHz Ant3

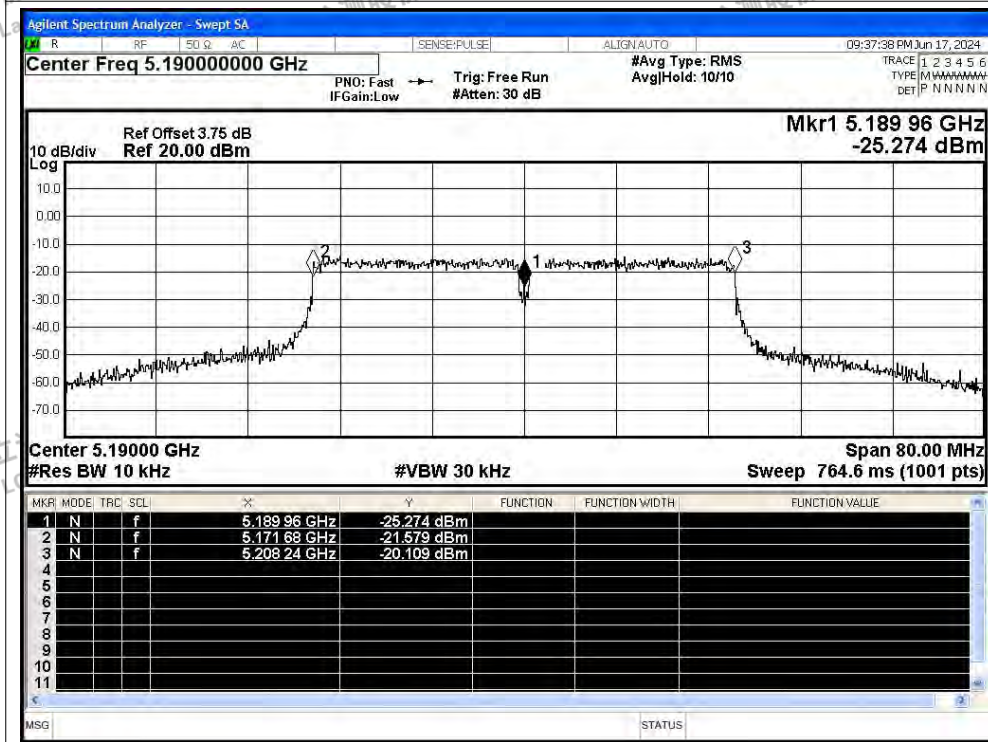

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant3

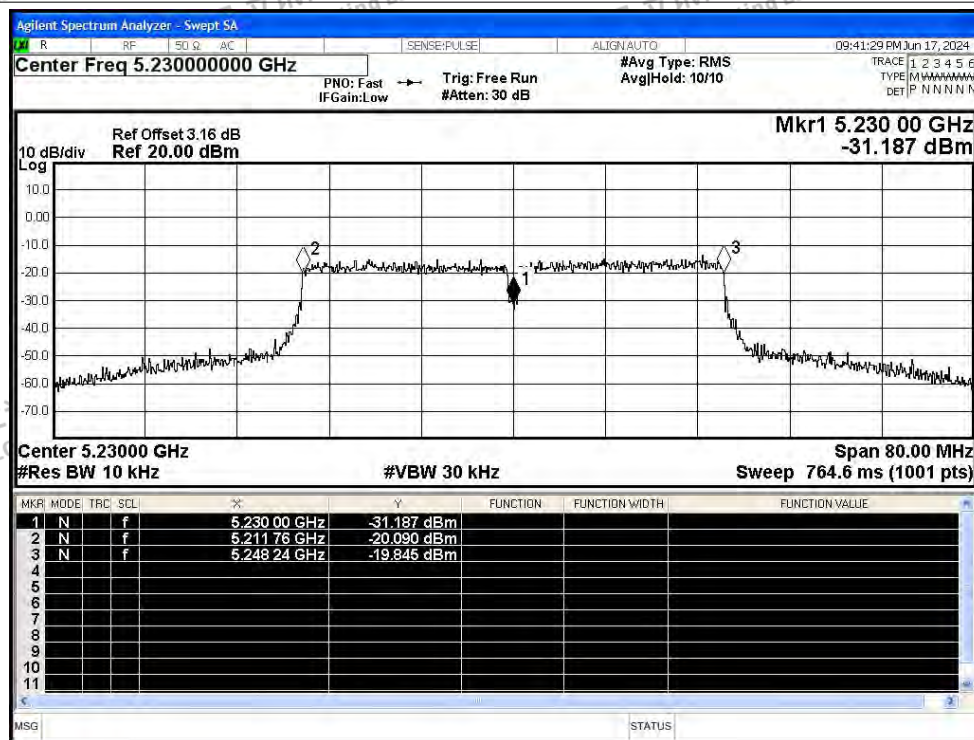

Freq. Stability NVNT ac80 5210MHz Ant3

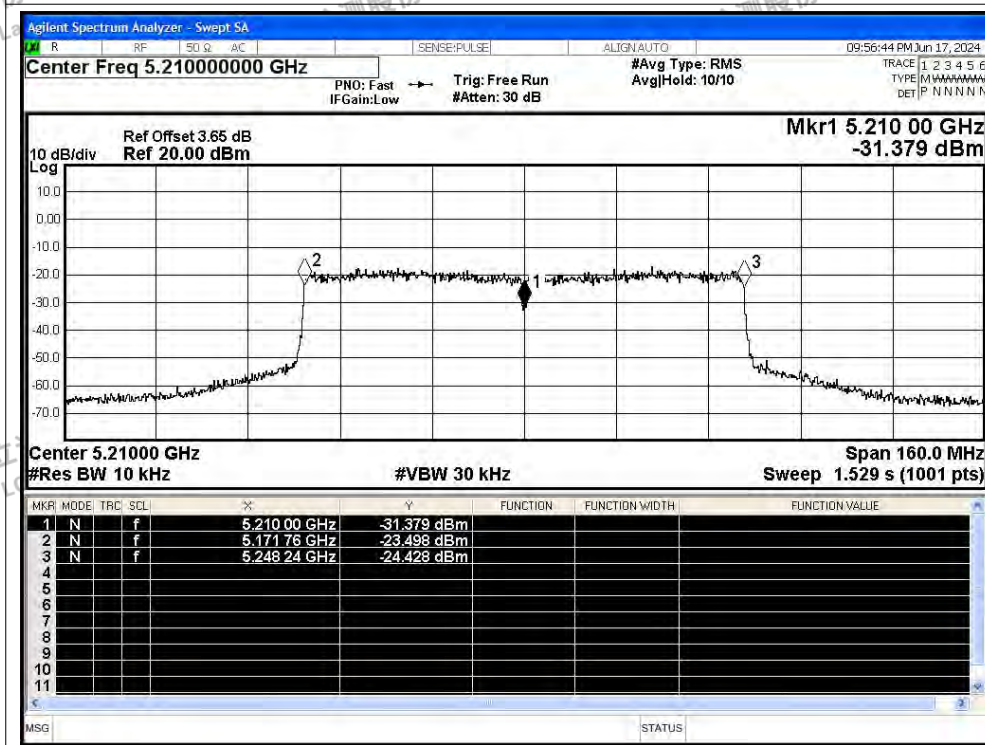

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5180MHz Ant3

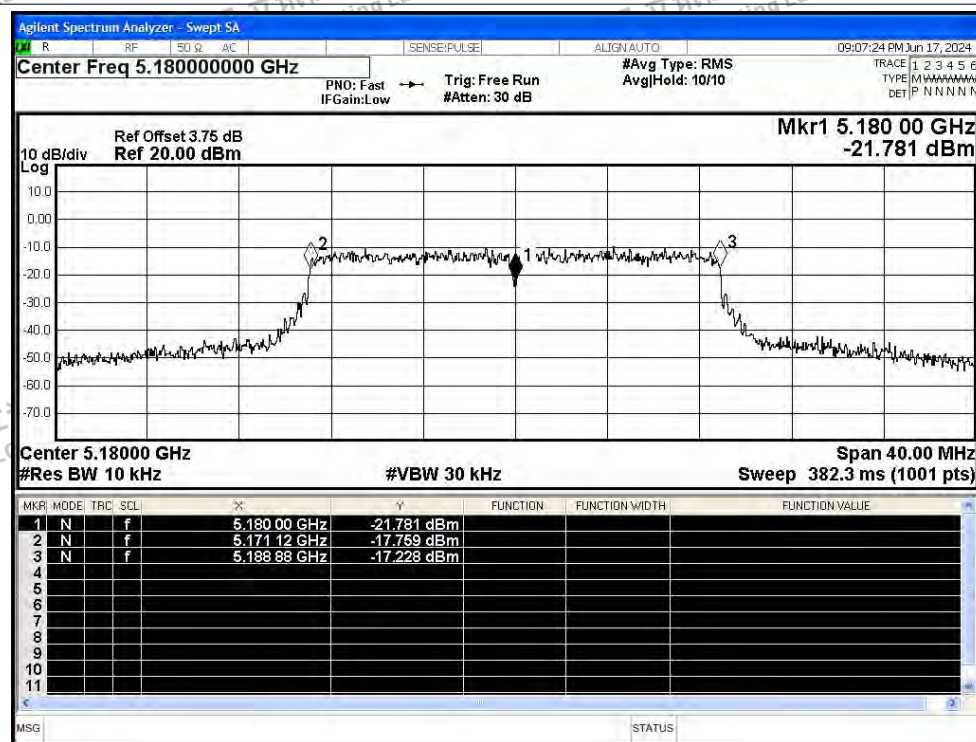

Freq. Stability NVNT ax20 5200MHz Ant3

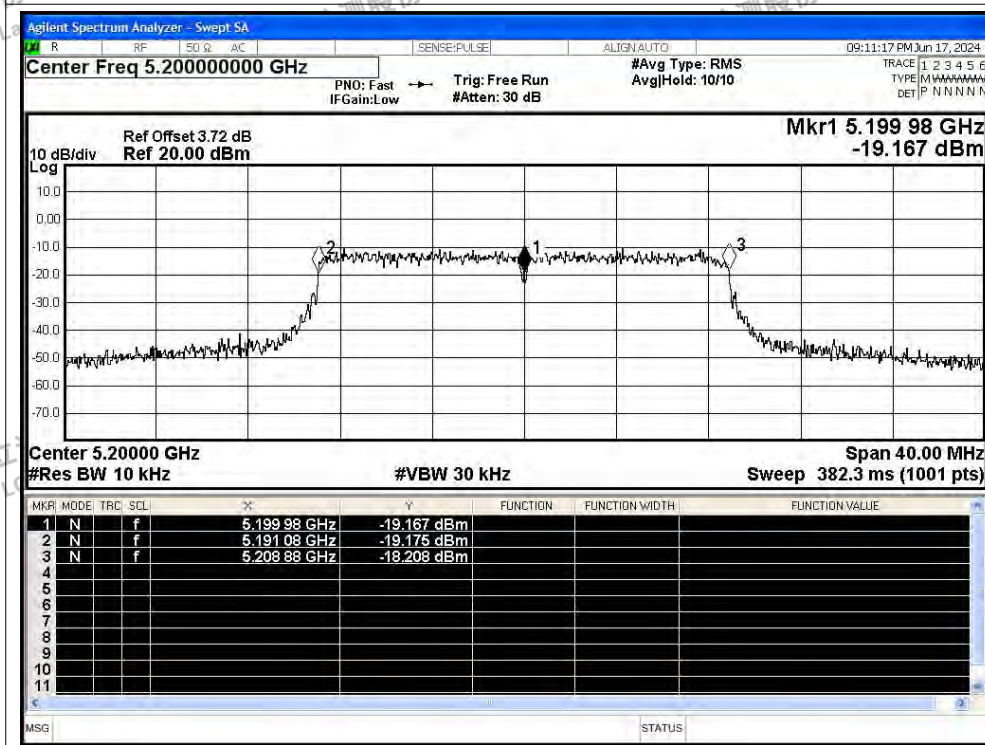

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5240MHz Ant3

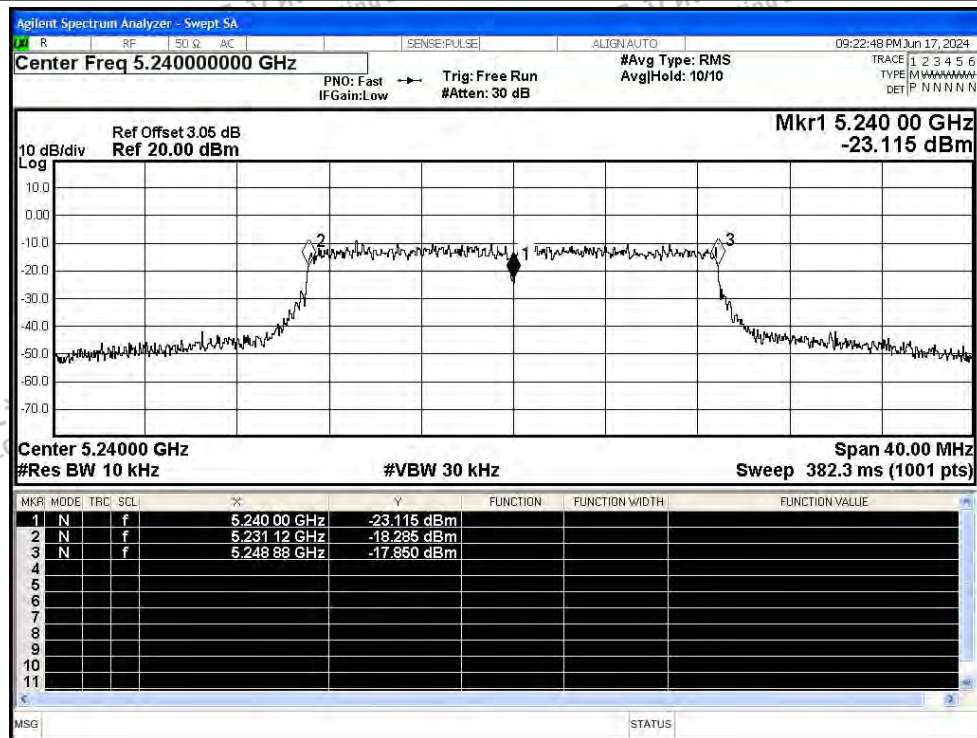

Freq. Stability NVNT ax40 5190MHz Ant3

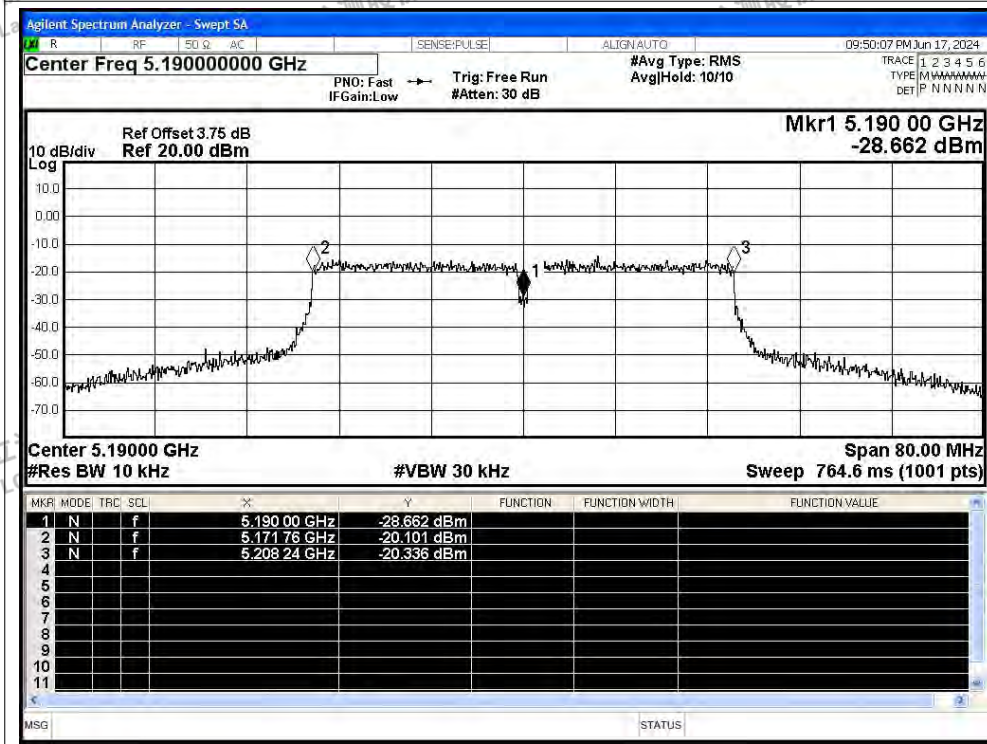

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5230MHz Ant3

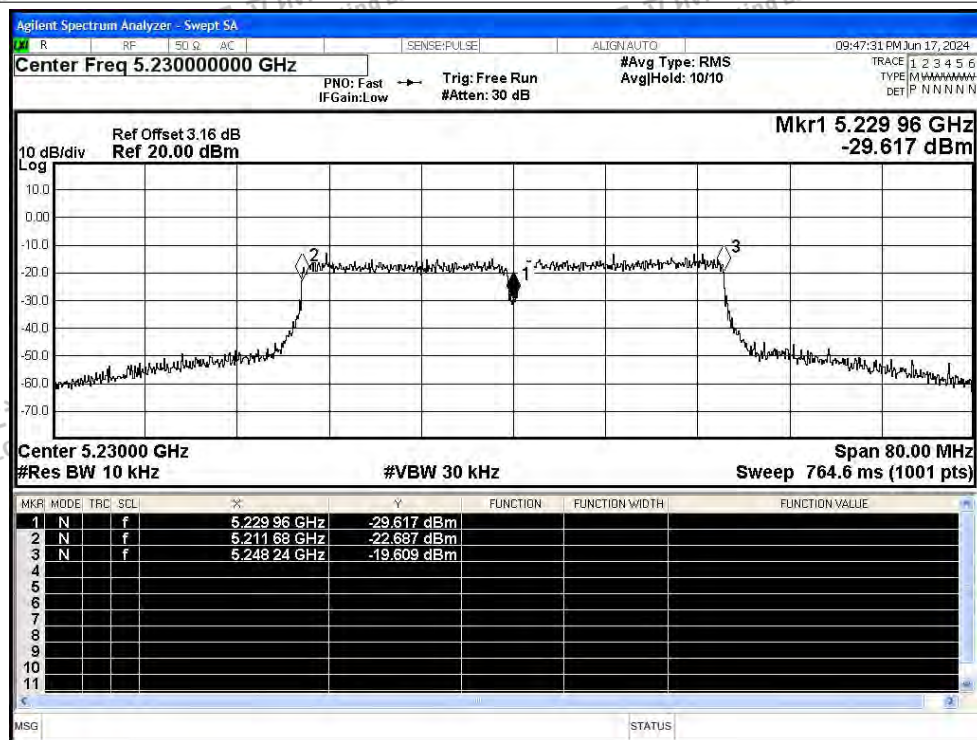

Freq. Stability NVNT ax80 5210MHz Ant3

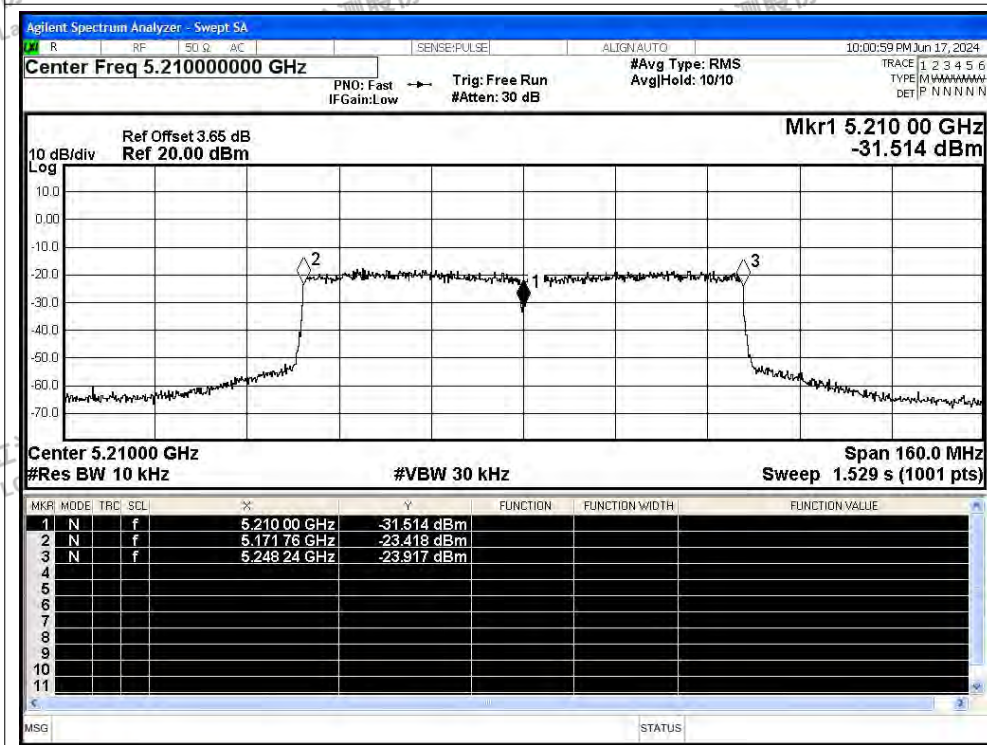

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	n20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant4	5199.96	-40000	-7.69	25	Pass
NVNT	n20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	n40	5190	Ant4	5190	0	0	25	Pass
NVNT	n40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac20	5180	Ant4	5180	0	0	25	Pass
NVNT	ac20	5200	Ant4	5199.96	-40000	-7.69	25	Pass
NVNT	ac20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant4	5190	0	0	25	Pass
NVNT	ac40	5230	Ant4	5230	0	0	25	Pass
NVNT	ac80	5210	Ant4	5210	0	0	25	Pass
NVNT	ax20	5180	Ant4	5179.98	-20000	-3.86	25	Pass
NVNT	ax20	5200	Ant4	5199.98	-20000	-3.85	25	Pass
NVNT	ax20	5240	Ant4	5239.98	-20000	-3.82	25	Pass
NVNT	ax40	5190	Ant4	5189.96	-40000	-7.71	25	Pass
NVNT	ax40	5230	Ant4	5230	0	0	25	Pass
NVNT	ax80	5210	Ant4	5210	0	0	25	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5180MHz Ant4

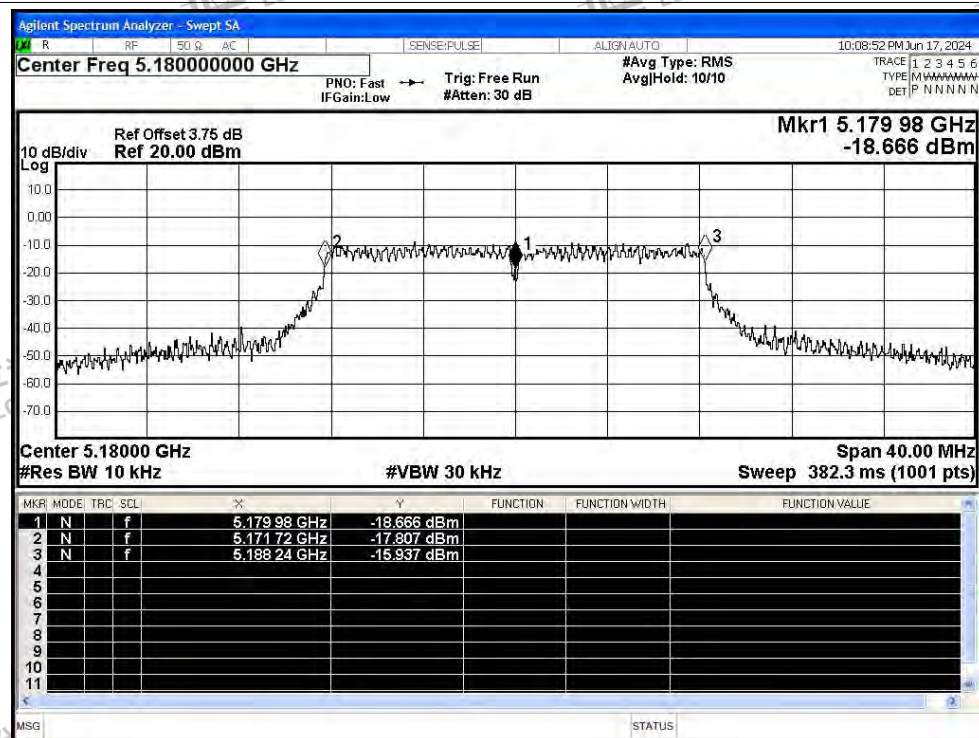

Freq. Stability NVNT a 5200MHz Ant4

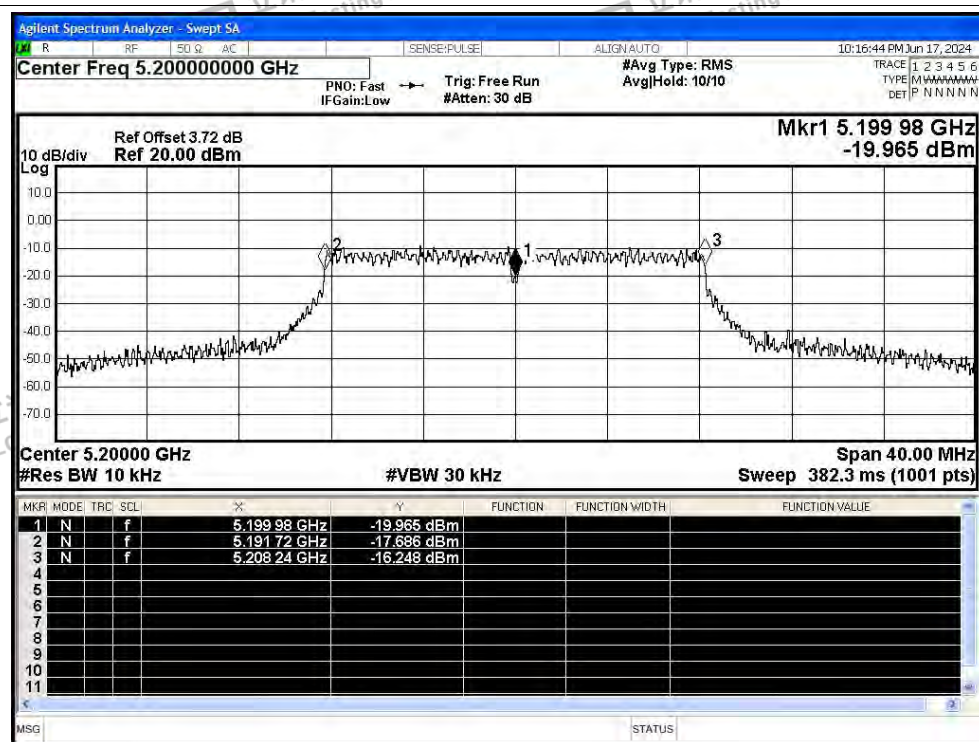

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5240MHz Ant4

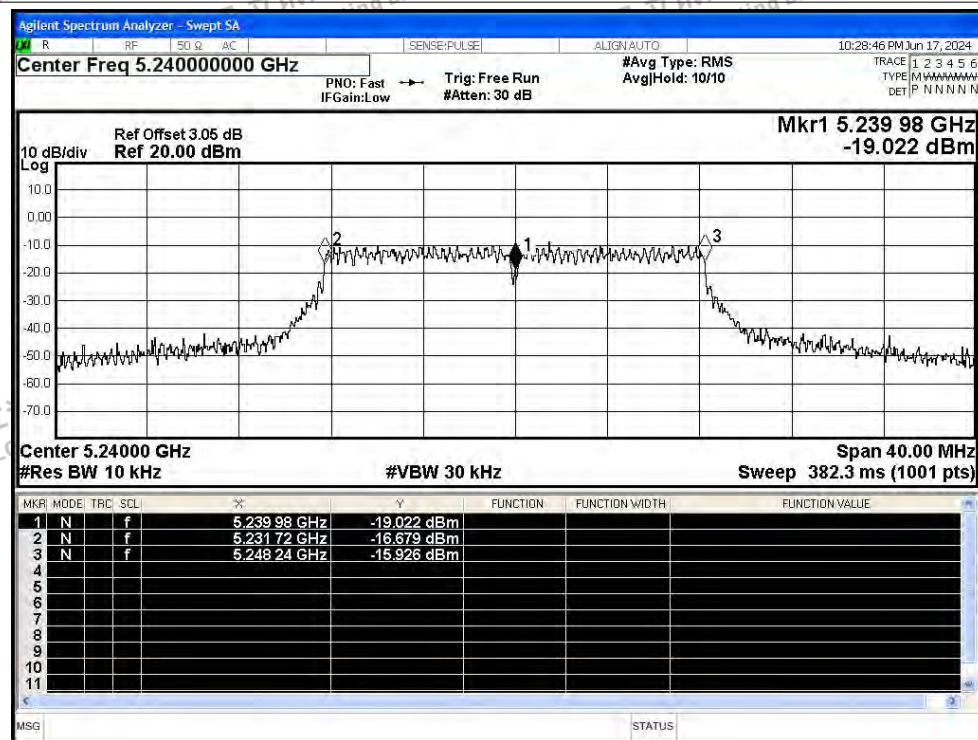

Freq. Stability NVNT n20 5180MHz Ant4

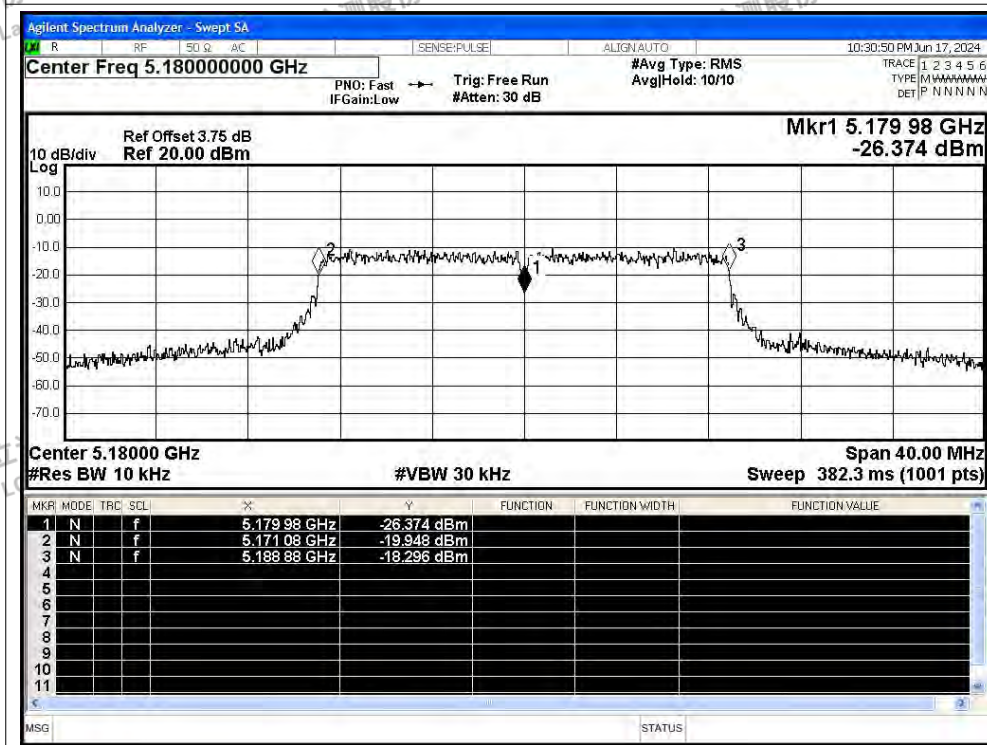

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5200MHz Ant4

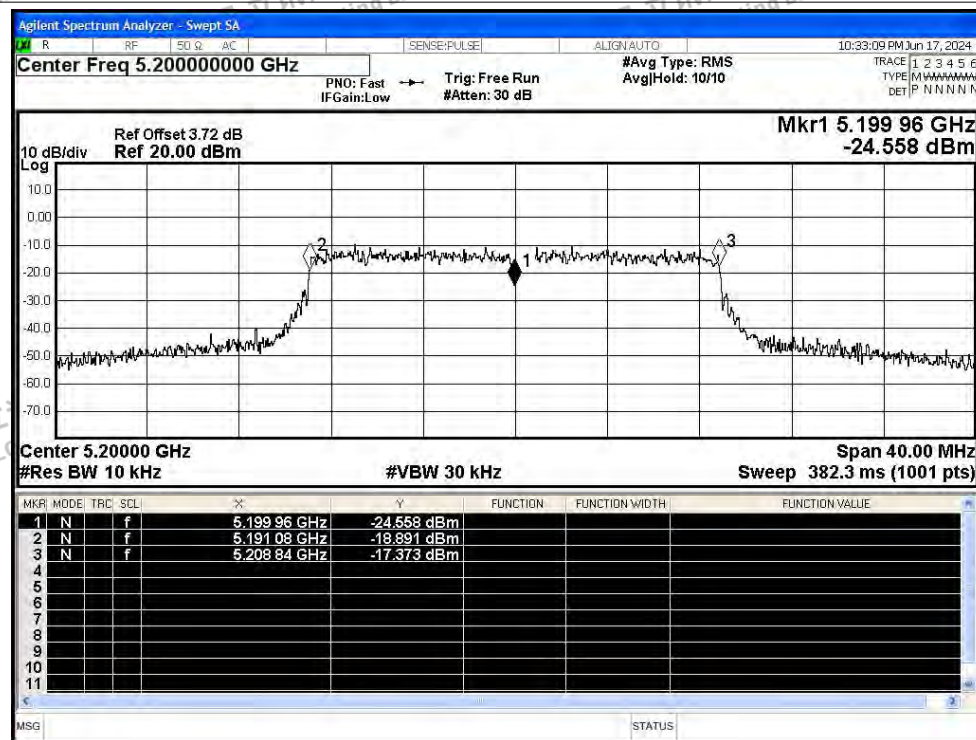

Freq. Stability NVNT n20 5240MHz Ant4

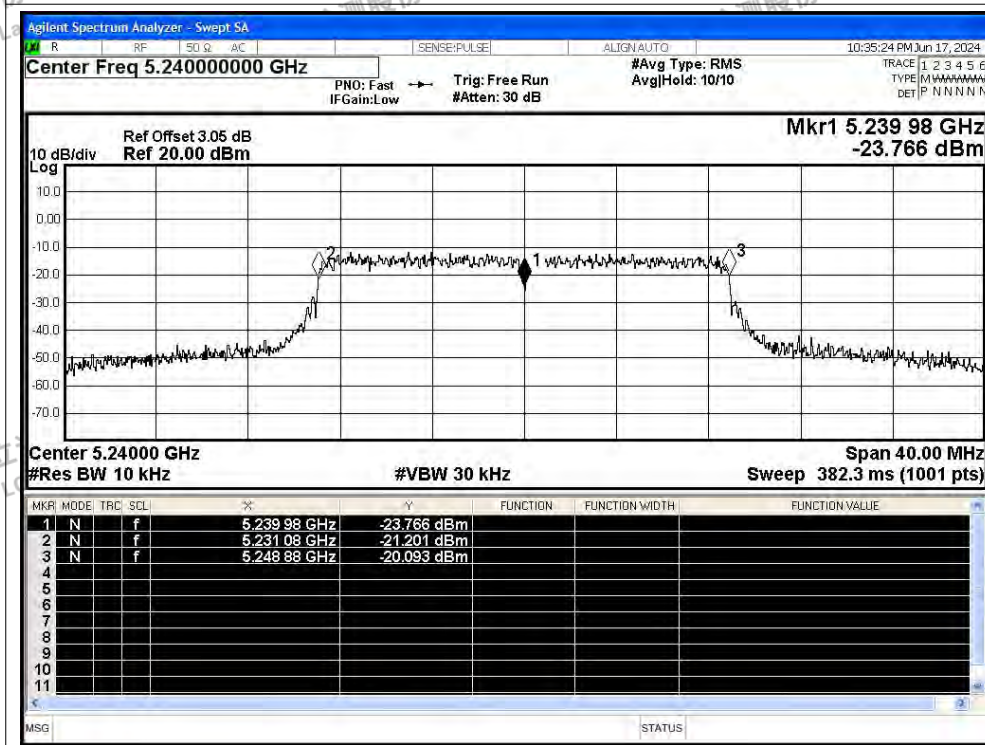

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5190MHz Ant4

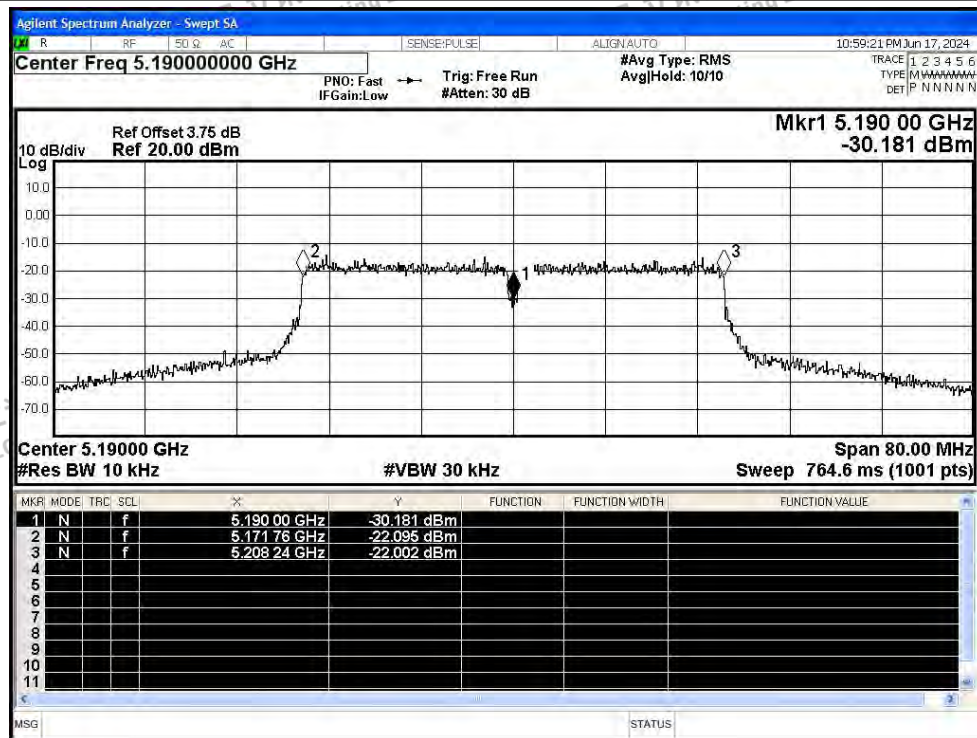

Freq. Stability NVNT n40 5230MHz Ant4

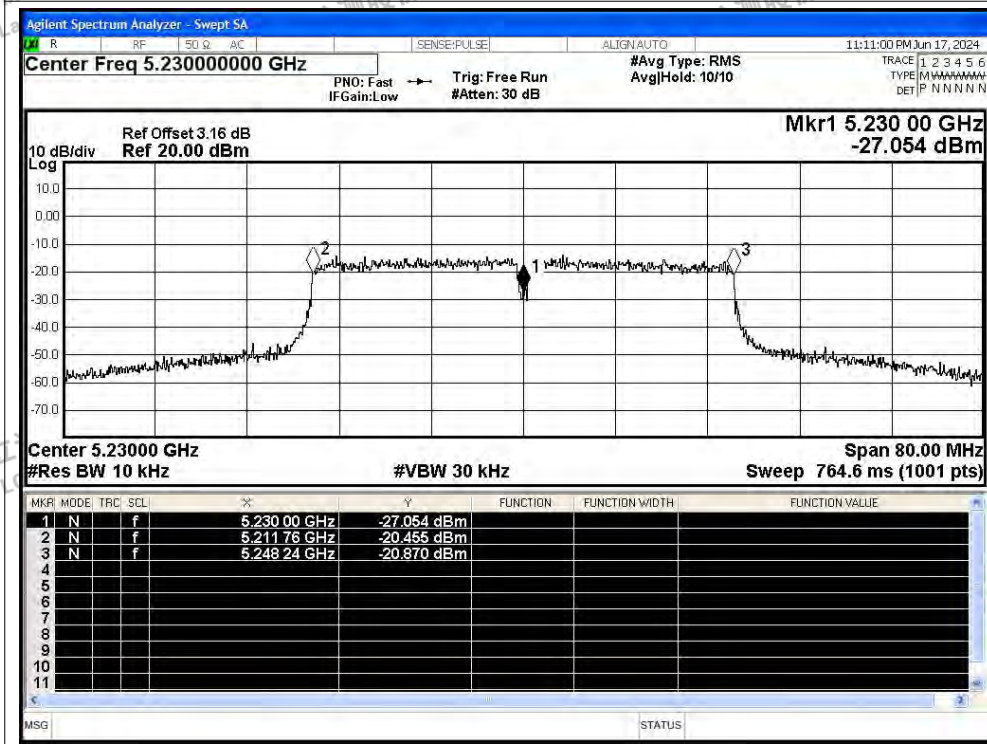

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity