





Restrict Band NVNT ac80 5775MHz Ant2 Peak

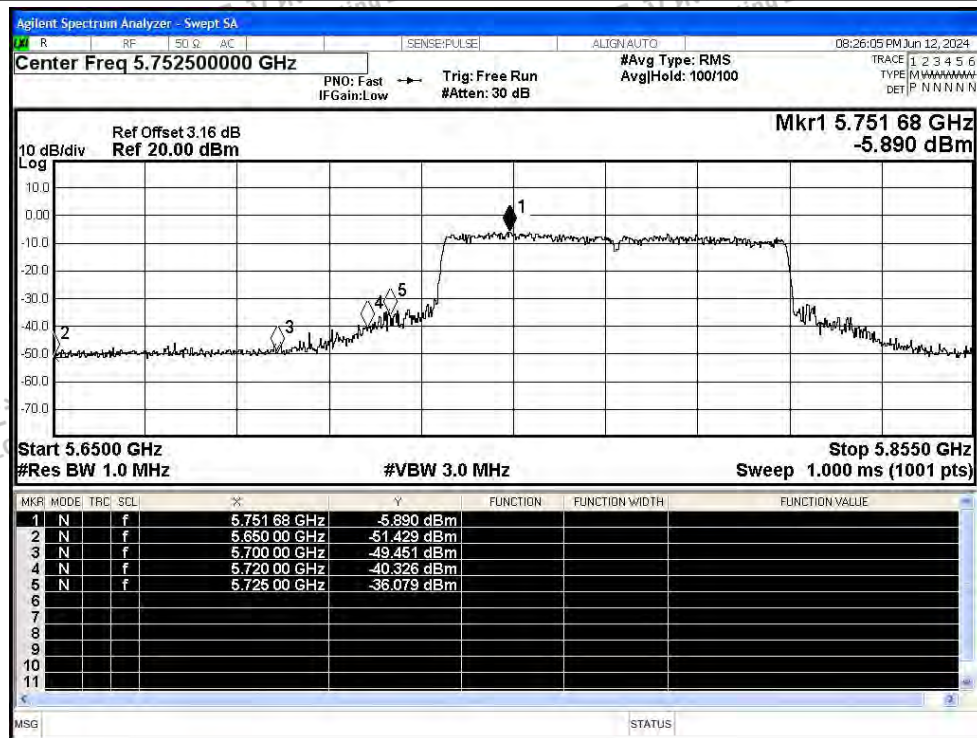

Restrict Band NVNT ac80 5775MHz Ant2 Average

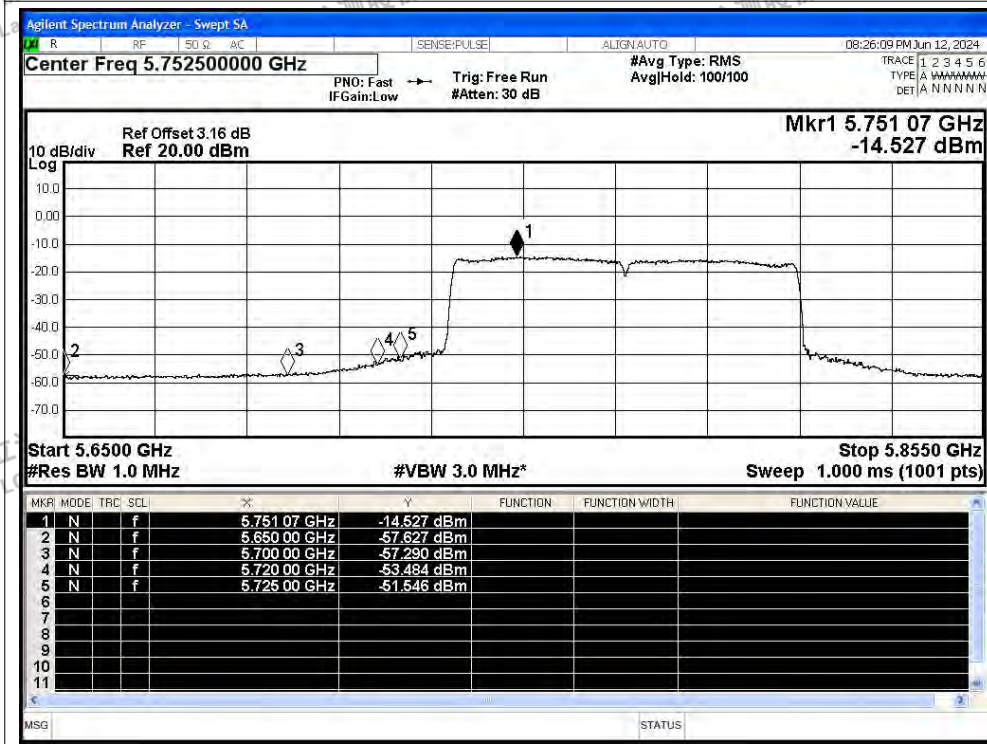

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant2 Peak



Restrict Band NVNT ax20 5745MHz Ant2 Average

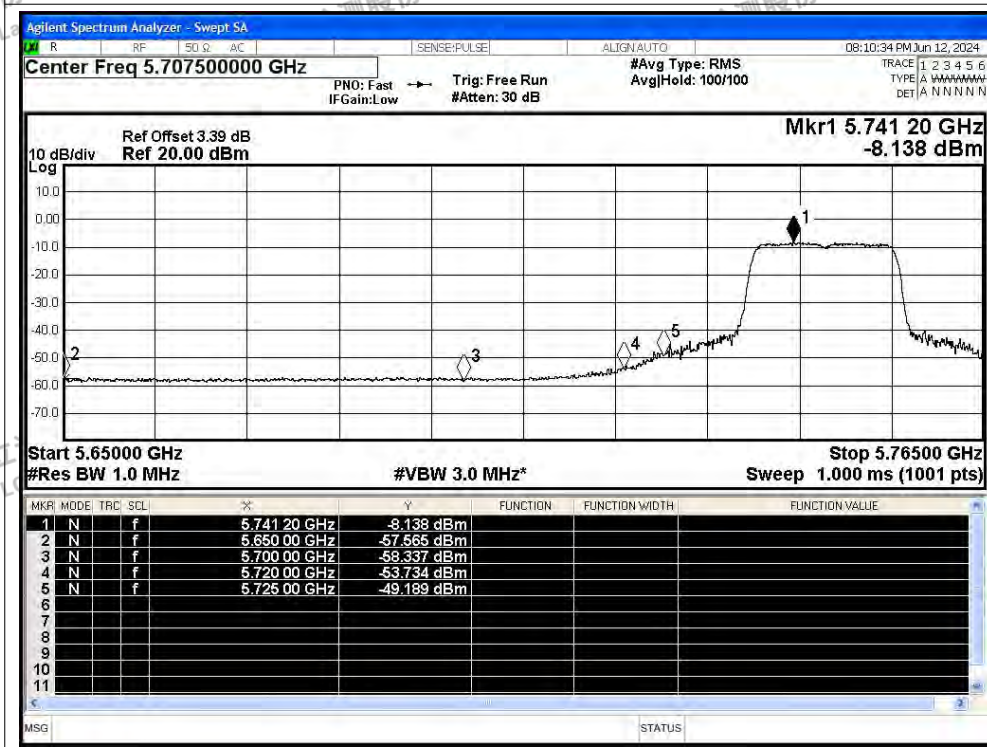

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant2 Peak



Restrict Band NVNT ax20 5825MHz Ant2 Average

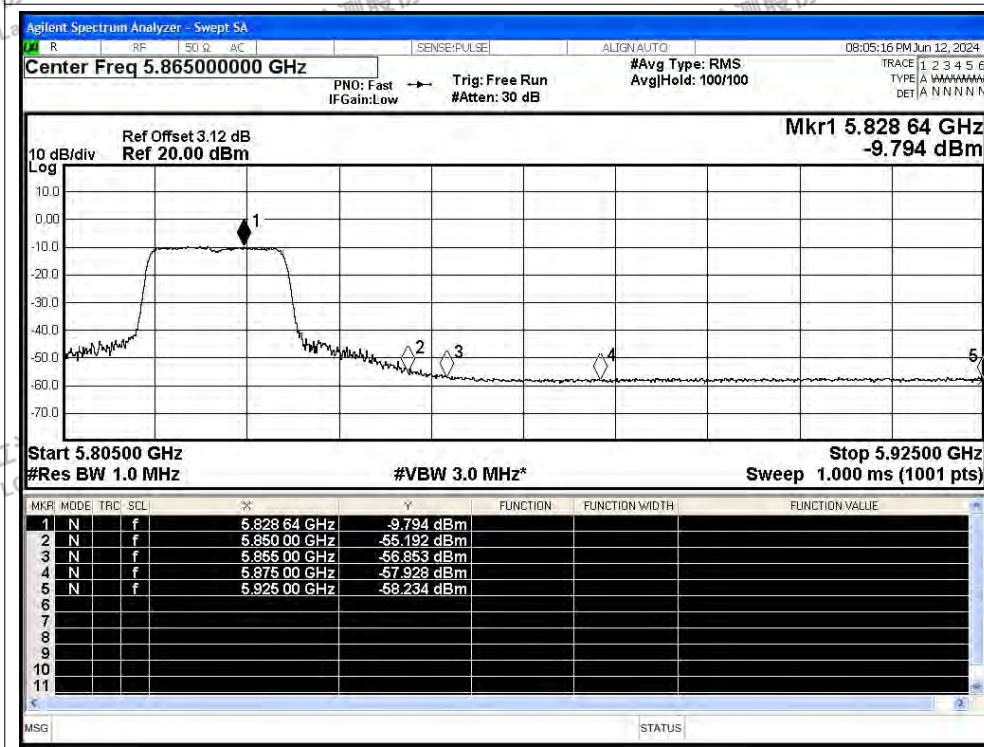

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant2 Peak



Restrict Band NVNT ax40 5755MHz Ant2 Average

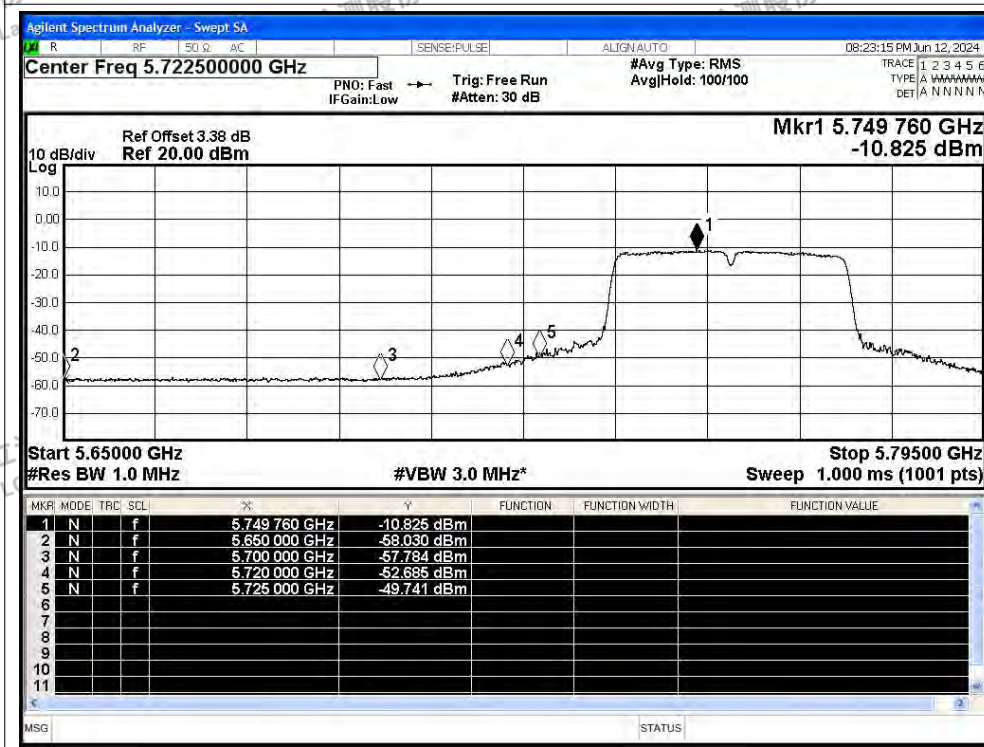

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant2 Peak

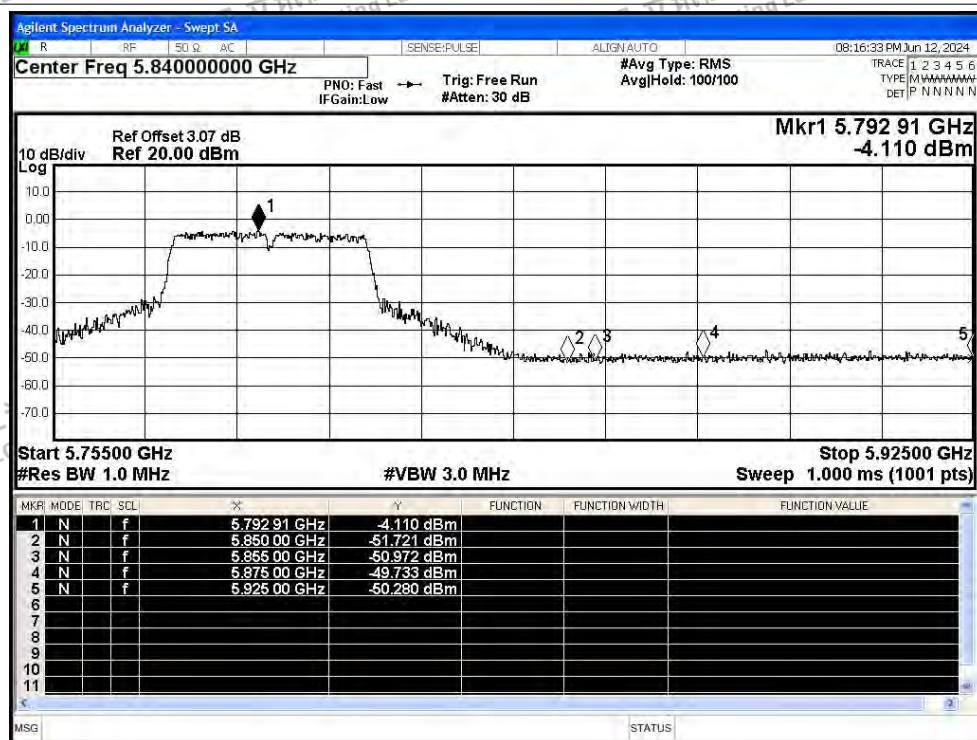

Restrict Band NVNT ax40 5795MHz Ant2 Average

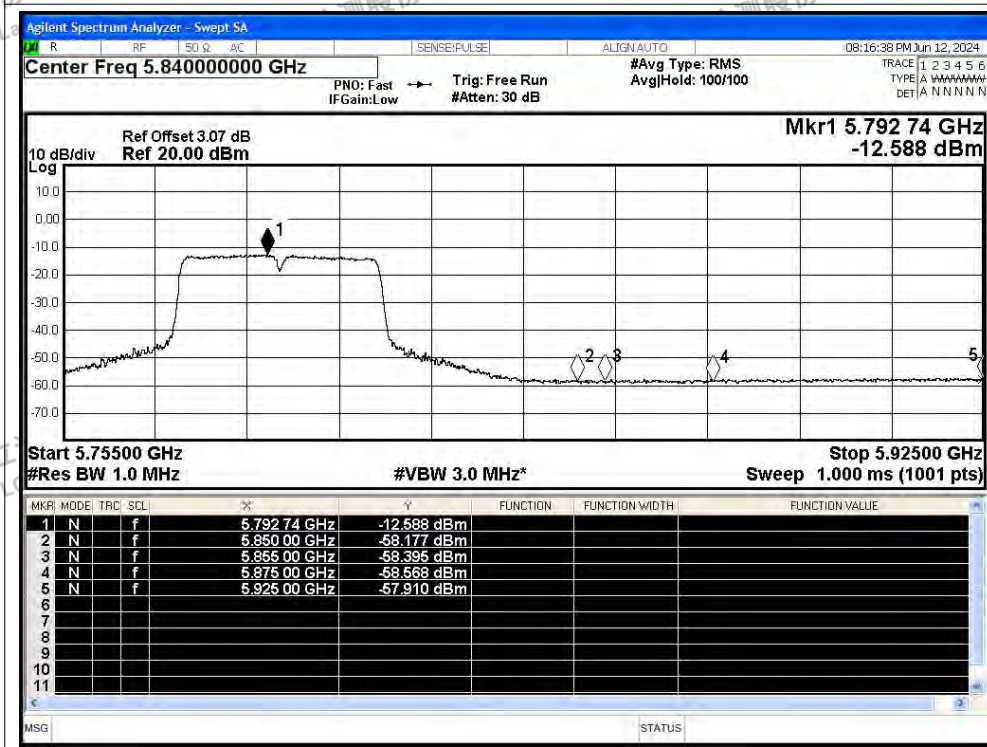

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

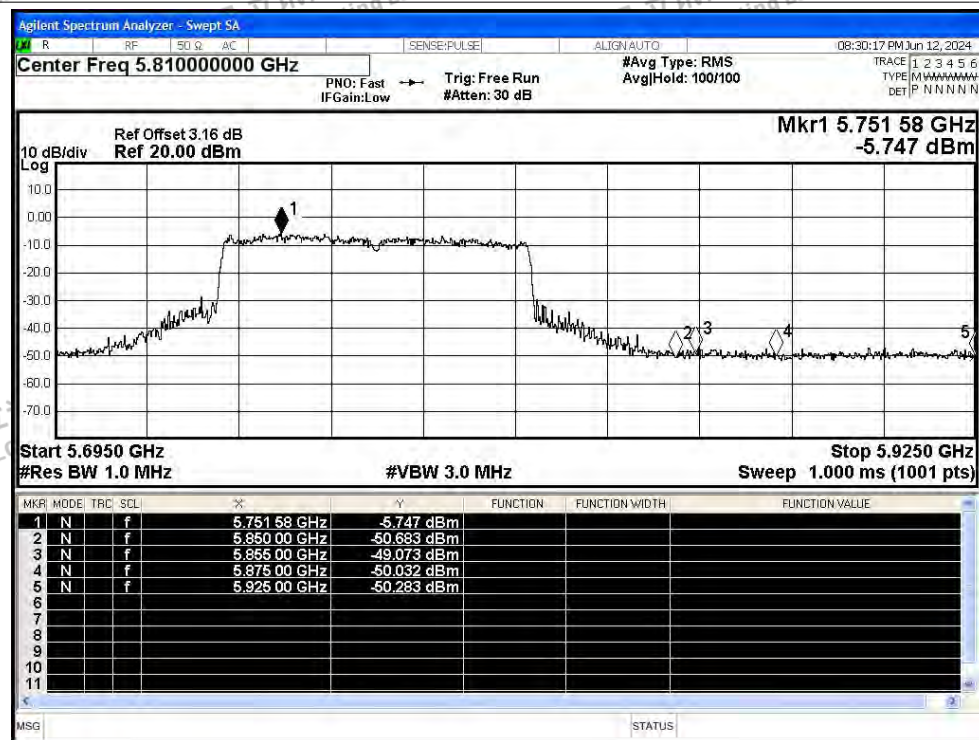

Restrict Band NVNT ax80 5775MHz Ant2 Average

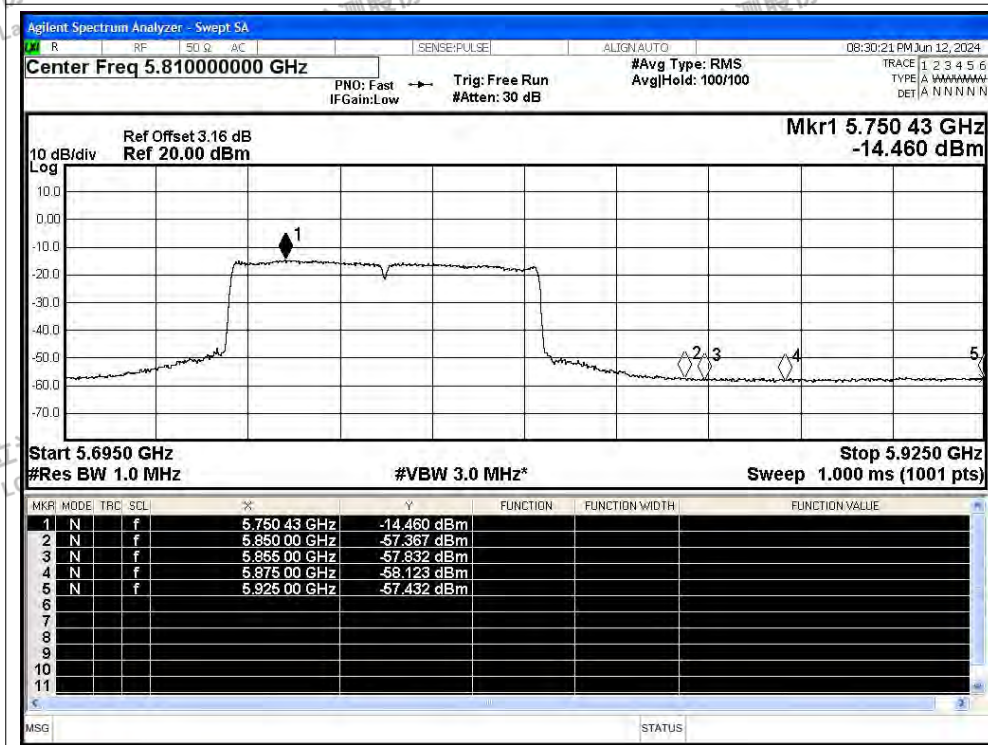

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant2 Peak

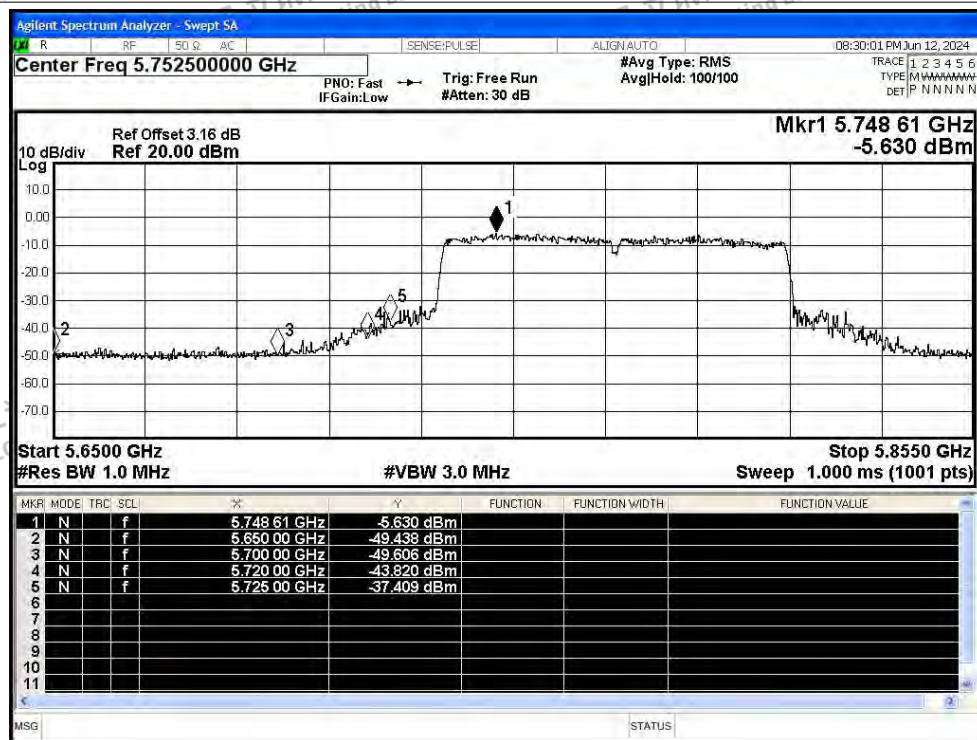

Restrict Band NVNT ax80 5775MHz Ant2 Average

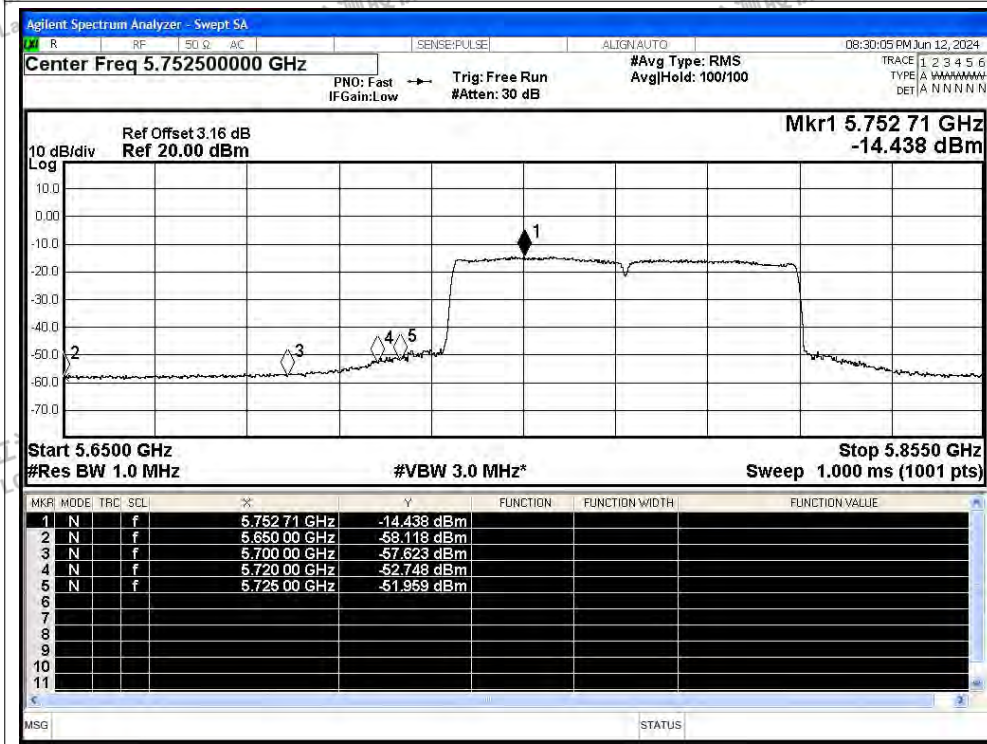

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant3	5650	-48.67	3.59	-	-45.08	Peak	-27	Pass
NVNT	a	5745	Ant3	5650	-58.17	3.59	0.24	-54.34	Average	-27	Pass
NVNT	a	5745	Ant3	5700	-49.8	3.59	-	-46.21	Peak	10	Pass
NVNT	a	5745	Ant3	5700	-57.34	3.59	0.24	-53.51	Average	10	Pass
NVNT	a	5745	Ant3	5720	-40.71	3.59	-	-37.12	Peak	15.6	Pass
NVNT	a	5745	Ant3	5720	-56.34	3.59	0.24	-52.51	Average	15.6	Pass
NVNT	a	5745	Ant3	5725	-37.18	3.59	-	-33.59	Peak	27	Pass
NVNT	a	5745	Ant3	5725	-48.31	3.59	0.24	-44.48	Average	27	Pass
NVNT	a	5825	Ant3	5850	-44.04	3.59	-	-40.45	Peak	27	Pass
NVNT	a	5825	Ant3	5850	-56.11	3.59	0.24	-52.28	Average	27	Pass
NVNT	a	5825	Ant3	5855	-48.69	3.59	-	-45.10	Peak	15.6	Pass
NVNT	a	5825	Ant3	5855	-57.3	3.59	0.24	-53.47	Average	15.6	Pass
NVNT	a	5825	Ant3	5875	-49.51	3.59	-	-45.92	Peak	10	Pass
NVNT	a	5825	Ant3	5875	-57.28	3.59	0.24	-53.45	Average	10	Pass
NVNT	a	5825	Ant3	5925	-48.95	3.59	-	-45.36	Peak	-27	Pass
NVNT	a	5825	Ant3	5925	-57.45	3.59	0.24	-53.62	Average	-27	Pass
NVNT	n20	5745	Ant3	5650	-50.38	3.59	-	-46.79	Peak	-27	Pass
NVNT	n20	5745	Ant3	5650	-57.35	3.59	0.28	-53.48	Average	-27	Pass
NVNT	n20	5745	Ant3	5700	-49.35	3.59	-	-45.76	Peak	10	Pass
NVNT	n20	5745	Ant3	5700	-56.67	3.59	0.28	-52.80	Average	10	Pass
NVNT	n20	5745	Ant3	5720	-35.08	3.59	-	-31.49	Peak	15.6	Pass
NVNT	n20	5745	Ant3	5720	-50.75	3.59	0.28	-46.88	Average	15.6	Pass
NVNT	n20	5745	Ant3	5725	-26.91	3.59	-	-23.32	Peak	27	Pass
NVNT	n20	5745	Ant3	5725	-44.98	3.59	0.28	-41.11	Average	27	Pass
NVNT	n20	5825	Ant3	5850	-40.23	3.59	-	-36.64	Peak	27	Pass
NVNT	n20	5825	Ant3	5850	-51.09	3.59	0.28	-47.22	Average	27	Pass
NVNT	n20	5825	Ant3	5855	-43.91	3.59	-	-40.32	Peak	15.6	Pass
NVNT	n20	5825	Ant3	5855	-54.71	3.59	0.28	-50.84	Average	15.6	Pass
NVNT	n20	5825	Ant3	5875	-49.16	3.59	-	-45.57	Peak	10	Pass
NVNT	n20	5825	Ant3	5875	-57.79	3.59	0.28	-53.92	Average	10	Pass
NVNT	n20	5825	Ant3	5925	-48.54	3.59	-	-44.95	Peak	-27	Pass
NVNT	n20	5825	Ant3	5925	-57.41	3.59	0.28	-53.54	Average	-27	Pass
NVNT	n40	5755	Ant3	5650	-49.3	3.59	-	-45.71	Peak	-27	Pass
NVNT	n40	5755	Ant3	5650	-57.57	3.59	0.12	-53.86	Average	-27	Pass
NVNT	n40	5755	Ant3	5700	-50.21	3.59	-	-46.62	Peak	10	Pass
NVNT	n40	5755	Ant3	5700	-58.14	3.59	0.12	-54.43	Average	10	Pass
NVNT	n40	5755	Ant3	5720	-44.05	3.59	-	-40.46	Peak	15.6	Pass
NVNT	n40	5755	Ant3	5720	-54.89	3.59	0.12	-51.18	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	n40	5755	Ant3	5725	-38.78	3.59	-	-35.19	Peak	27	Pass
NVNT	n40	5755	Ant3	5725	-54.51	3.59	0.12	-50.80	Average	27	Pass
NVNT	n40	5795	Ant3	5850	-49.36	3.59	-	-45.77	Peak	27	Pass
NVNT	n40	5795	Ant3	5850	-58.09	3.59	0.12	-54.38	Average	27	Pass
NVNT	n40	5795	Ant3	5855	-50.5	3.59	-	-46.91	Peak	15.6	Pass
NVNT	n40	5795	Ant3	5855	-58.26	3.59	0.12	-54.55	Average	15.6	Pass
NVNT	n40	5795	Ant3	5875	-51.61	3.59	-	-48.02	Peak	10	Pass
NVNT	n40	5795	Ant3	5875	-58.48	3.59	0.12	-54.77	Average	10	Pass
NVNT	n40	5795	Ant3	5925	-49.35	3.59	-	-45.76	Peak	-27	Pass
NVNT	n40	5795	Ant3	5925	-57.73	3.59	0.12	-54.02	Average	-27	Pass
NVNT	ac20	5745	Ant3	5650	-48.33	3.59	-	-44.74	Peak	-27	Pass
NVNT	ac20	5745	Ant3	5650	-57.73	3.59	0.28	-53.86	Average	-27	Pass
NVNT	ac20	5745	Ant3	5700	-49.54	3.59	-	-45.95	Peak	10	Pass
NVNT	ac20	5745	Ant3	5700	-57.35	3.59	0.28	-53.48	Average	10	Pass
NVNT	ac20	5745	Ant3	5720	-39.65	3.59	-	-36.06	Peak	15.6	Pass
NVNT	ac20	5745	Ant3	5720	-55.39	3.59	0.28	-51.52	Average	15.6	Pass
NVNT	ac20	5745	Ant3	5725	-34.17	3.59	-	-30.58	Peak	27	Pass
NVNT	ac20	5745	Ant3	5725	-51.36	3.59	0.28	-47.49	Average	27	Pass
NVNT	ac20	5825	Ant3	5850	-28.65	3.59	-	-25.06	Peak	27	Pass
NVNT	ac20	5825	Ant3	5850	-42.41	3.59	0.28	-38.54	Average	27	Pass
NVNT	ac20	5825	Ant3	5855	-35.39	3.59	-	-31.80	Peak	15.6	Pass
NVNT	ac20	5825	Ant3	5855	-46.96	3.59	0.28	-43.09	Average	15.6	Pass
NVNT	ac20	5825	Ant3	5875	-46.34	3.59	-	-42.75	Peak	10	Pass
NVNT	ac20	5825	Ant3	5875	-55.29	3.59	0.28	-51.42	Average	10	Pass
NVNT	ac20	5825	Ant3	5925	-47.4	3.59	-	-43.81	Peak	-27	Pass
NVNT	ac20	5825	Ant3	5925	-56.55	3.59	0.28	-52.68	Average	-27	Pass
NVNT	ac40	5755	Ant3	5650	-49.74	3.59	-	-46.15	Peak	-27	Pass
NVNT	ac40	5755	Ant3	5650	-57.51	3.59	0.12	-53.80	Average	-27	Pass
NVNT	ac40	5755	Ant3	5700	-49.89	3.59	-	-46.30	Peak	10	Pass
NVNT	ac40	5755	Ant3	5700	-57.21	3.59	0.12	-53.50	Average	10	Pass
NVNT	ac40	5755	Ant3	5720	-43.4	3.59	-	-39.81	Peak	15.6	Pass
NVNT	ac40	5755	Ant3	5720	-54.19	3.59	0.12	-50.48	Average	15.6	Pass
NVNT	ac40	5755	Ant3	5725	-38.81	3.59	-	-35.22	Peak	27	Pass
NVNT	ac40	5755	Ant3	5725	-52.33	3.59	0.12	-48.62	Average	27	Pass
NVNT	ac40	5795	Ant3	5850	-50.06	3.59	-	-46.47	Peak	27	Pass
NVNT	ac40	5795	Ant3	5850	-58.47	3.59	0.12	-54.76	Average	27	Pass
NVNT	ac40	5795	Ant3	5855	-49.76	3.59	-	-46.17	Peak	15.6	Pass
NVNT	ac40	5795	Ant3	5855	-58.27	3.59	0.12	-54.56	Average	15.6	Pass
NVNT	ac40	5795	Ant3	5875	-49.61	3.59	-	-46.02	Peak	10	Pass
NVNT	ac40	5795	Ant3	5875	-58.25	3.59	0.12	-54.54	Average	10	Pass
NVNT	ac40	5795	Ant3	5925	-50.42	3.59	-	-46.83	Peak	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5795	Ant3	5925	-57.72	3.59	0.12	-54.01	Average	-27	Pass
NVNT	ac80	5775	Ant3	5850	-50.33	3.59	-	-46.74	Peak	27	Pass
NVNT	ac80	5775	Ant3	5850	-57.95	3.59	0.25	-54.11	Average	27	Pass
NVNT	ac80	5775	Ant3	5855	-51.32	3.59	-	-47.73	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5855	-58.16	3.59	0.25	-54.32	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5875	-50.03	3.59	-	-46.44	Peak	10	Pass
NVNT	ac80	5775	Ant3	5875	-58.21	3.59	0.25	-54.37	Average	10	Pass
NVNT	ac80	5775	Ant3	5925	-51.02	3.59	-	-47.43	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5925	-57.65	3.59	0.25	-53.81	Average	-27	Pass
NVNT	ac80	5775	Ant3	5650	-49.54	3.59	-	-45.95	Peak	-27	Pass
NVNT	ac80	5775	Ant3	5650	-57.61	3.59	0.25	-53.77	Average	-27	Pass
NVNT	ac80	5775	Ant3	5700	-50.66	3.59	-	-47.07	Peak	10	Pass
NVNT	ac80	5775	Ant3	5700	-58.61	3.59	0.25	-54.77	Average	10	Pass
NVNT	ac80	5775	Ant3	5720	-46.77	3.59	-	-43.18	Peak	15.6	Pass
NVNT	ac80	5775	Ant3	5720	-55.27	3.59	0.25	-51.43	Average	15.6	Pass
NVNT	ac80	5775	Ant3	5725	-39.35	3.59	-	-35.76	Peak	27	Pass
NVNT	ac80	5775	Ant3	5725	-53.62	3.59	0.25	-49.78	Average	27	Pass
NVNT	ax20	5745	Ant3	5650	-48.2	3.59	-	-44.61	Peak	-27	Pass
NVNT	ax20	5745	Ant3	5650	-57.5	3.59	0.28	-53.63	Average	-27	Pass
NVNT	ax20	5745	Ant3	5700	-47.98	3.59	-	-44.39	Peak	10	Pass
NVNT	ax20	5745	Ant3	5700	-57.82	3.59	0.28	-53.95	Average	10	Pass
NVNT	ax20	5745	Ant3	5720	-43.97	3.59	-	-40.38	Peak	15.6	Pass
NVNT	ax20	5745	Ant3	5720	-54.3	3.59	0.28	-50.43	Average	15.6	Pass
NVNT	ax20	5745	Ant3	5725	-35.72	3.59	-	-32.13	Peak	27	Pass
NVNT	ax20	5745	Ant3	5725	-49.62	3.59	0.28	-45.75	Average	27	Pass
NVNT	ax20	5825	Ant3	5850	-44.88	3.59	-	-41.29	Peak	27	Pass
NVNT	ax20	5825	Ant3	5850	-55.21	3.59	0.28	-51.34	Average	27	Pass
NVNT	ax20	5825	Ant3	5855	-48.25	3.59	-	-44.66	Peak	15.6	Pass
NVNT	ax20	5825	Ant3	5855	-57.6	3.59	0.28	-53.73	Average	15.6	Pass
NVNT	ax20	5825	Ant3	5875	-49.5	3.59	-	-45.91	Peak	10	Pass
NVNT	ax20	5825	Ant3	5875	-57.87	3.59	0.28	-54.00	Average	10	Pass
NVNT	ax20	5825	Ant3	5925	-48.52	3.59	-	-44.93	Peak	-27	Pass
NVNT	ax20	5825	Ant3	5925	-57.14	3.59	0.28	-53.27	Average	-27	Pass
NVNT	ax40	5755	Ant3	5650	-49.7	3.59	-	-46.11	Peak	-27	Pass
NVNT	ax40	5755	Ant3	5650	-58.18	3.59	0.12	-54.47	Average	-27	Pass
NVNT	ax40	5755	Ant3	5700	-51.04	3.59	-	-47.45	Peak	10	Pass
NVNT	ax40	5755	Ant3	5700	-58.49	3.59	0.12	-54.78	Average	10	Pass
NVNT	ax40	5755	Ant3	5720	-42.47	3.59	-	-38.88	Peak	15.6	Pass
NVNT	ax40	5755	Ant3	5720	-55.39	3.59	0.12	-51.68	Average	15.6	Pass
NVNT	ax40	5755	Ant3	5725	-35.72	3.59	-	-32.13	Peak	27	Pass
NVNT	ax40	5755	Ant3	5725	-53.51	3.59	0.12	-49.80	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5795	Ant3	5850	-49.27	3.59	-	-45.68	Peak	27	Pass
NVNT	ax40	5795	Ant3	5850	-58.38	3.59	0.12	-54.67	Average	27	Pass
NVNT	ax40	5795	Ant3	5855	-50.97	3.59	-	-47.38	Peak	15.6	Pass
NVNT	ax40	5795	Ant3	5855	-58.71	3.59	0.12	-55.00	Average	15.6	Pass
NVNT	ax40	5795	Ant3	5875	-50.49	3.59	-	-46.90	Peak	10	Pass
NVNT	ax40	5795	Ant3	5875	-58.34	3.59	0.12	-54.63	Average	10	Pass
NVNT	ax40	5795	Ant3	5925	-49.63	3.59	-	-46.04	Peak	-27	Pass
NVNT	ax40	5795	Ant3	5925	-58.45	3.59	0.12	-54.74	Average	-27	Pass
NVNT	ax80	5775	Ant3	5850	-49.54	3.59	-	-45.95	Peak	27	Pass
NVNT	ax80	5775	Ant3	5850	-58.09	3.59	0.25	-54.25	Average	27	Pass
NVNT	ax80	5775	Ant3	5855	-51.42	3.59	-	-47.83	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5855	-58.14	3.59	0.25	-54.30	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5875	-50.26	3.59	-	-46.67	Peak	10	Pass
NVNT	ax80	5775	Ant3	5875	-58.31	3.59	0.25	-54.47	Average	10	Pass
NVNT	ax80	5775	Ant3	5925	-50.78	3.59	-	-47.19	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5925	-58.04	3.59	0.25	-54.20	Average	-27	Pass
NVNT	ax80	5775	Ant3	5650	-49.99	3.59	-	-46.40	Peak	-27	Pass
NVNT	ax80	5775	Ant3	5650	-58.12	3.59	0.25	-54.28	Average	-27	Pass
NVNT	ax80	5775	Ant3	5700	-49.46	3.59	-	-45.87	Peak	10	Pass
NVNT	ax80	5775	Ant3	5700	-57.95	3.59	0.25	-54.11	Average	10	Pass
NVNT	ax80	5775	Ant3	5720	-45.21	3.59	-	-41.62	Peak	15.6	Pass
NVNT	ax80	5775	Ant3	5720	-55.56	3.59	0.25	-51.72	Average	15.6	Pass
NVNT	ax80	5775	Ant3	5725	-43.72	3.59	-	-40.13	Peak	27	Pass
NVNT	ax80	5775	Ant3	5725	-53.38	3.59	0.25	-49.54	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5745MHz Ant3 Peak

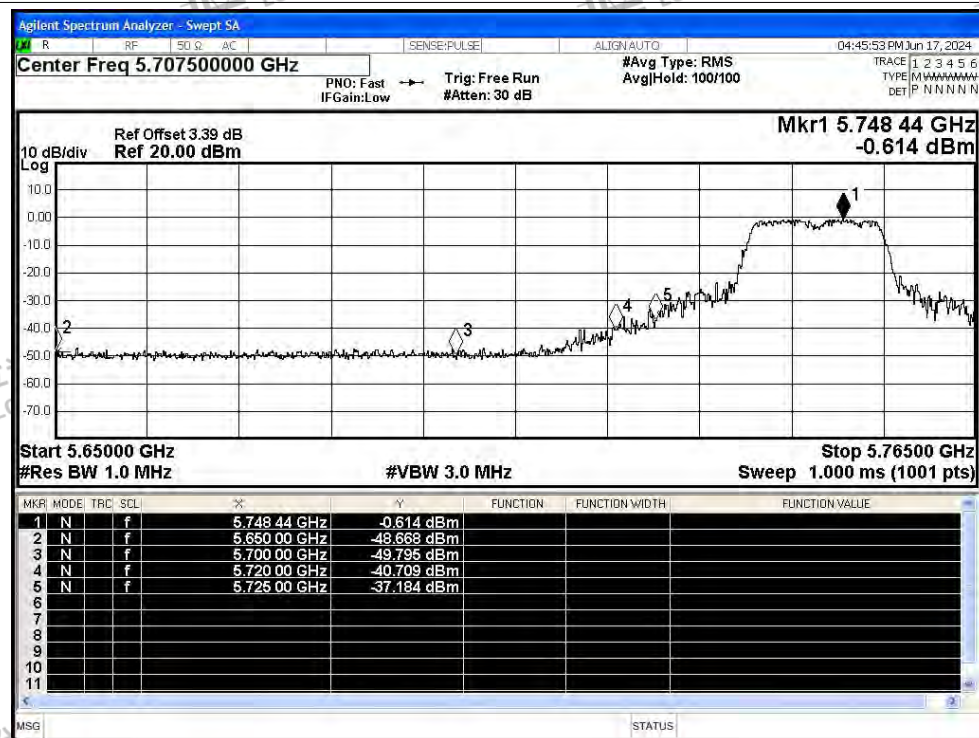

Restrict Band NVNT a 5745MHz Ant3 Average

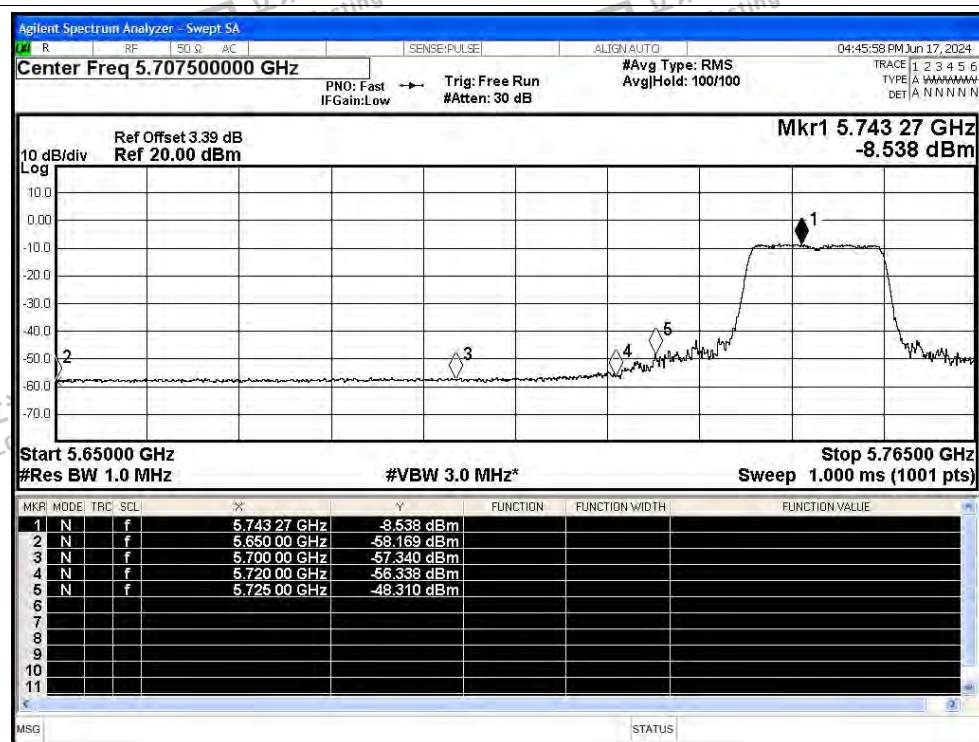

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant3 Peak



Restrict Band NVNT a 5825MHz Ant3 Average

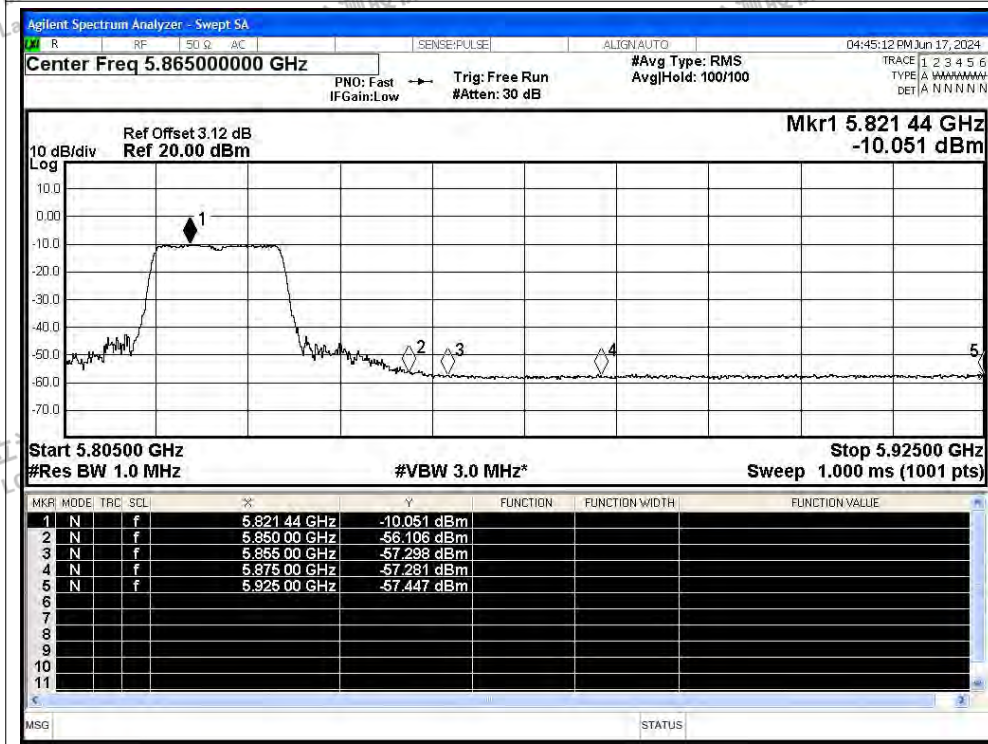

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant3 Peak



Restrict Band NVNT n20 5745MHz Ant3 Average

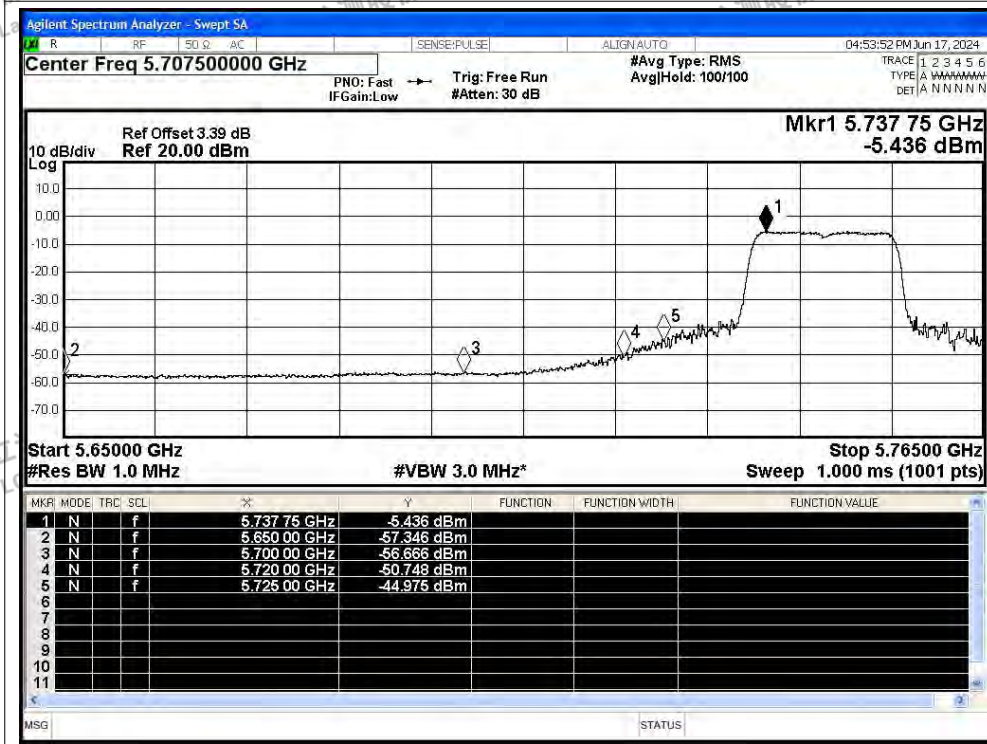

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant3 Peak

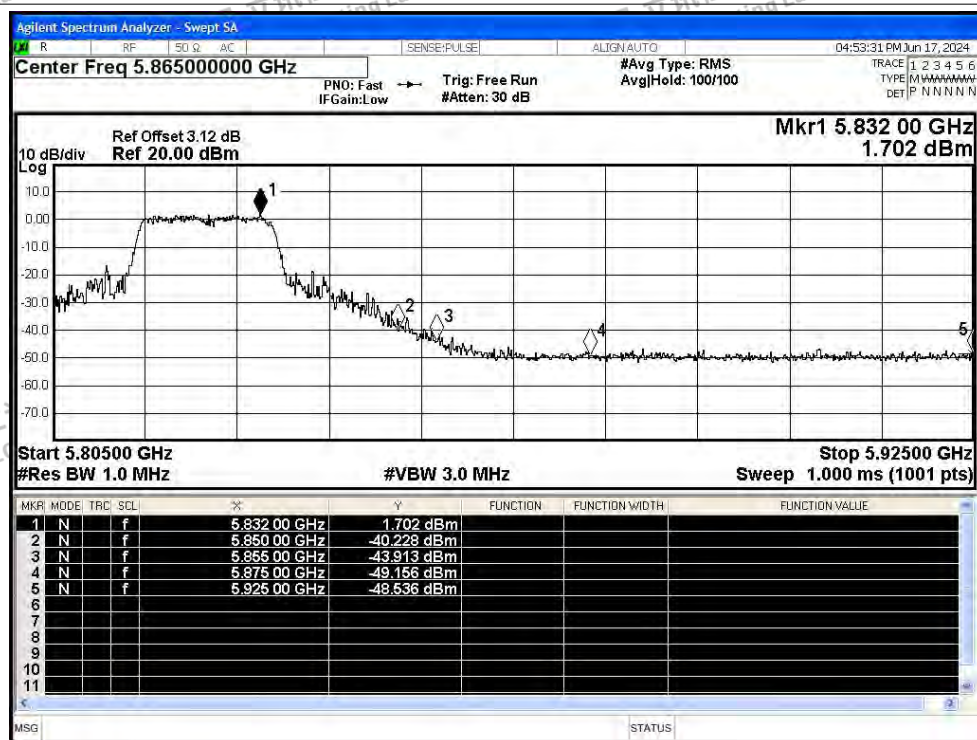

Restrict Band NVNT n20 5825MHz Ant3 Average

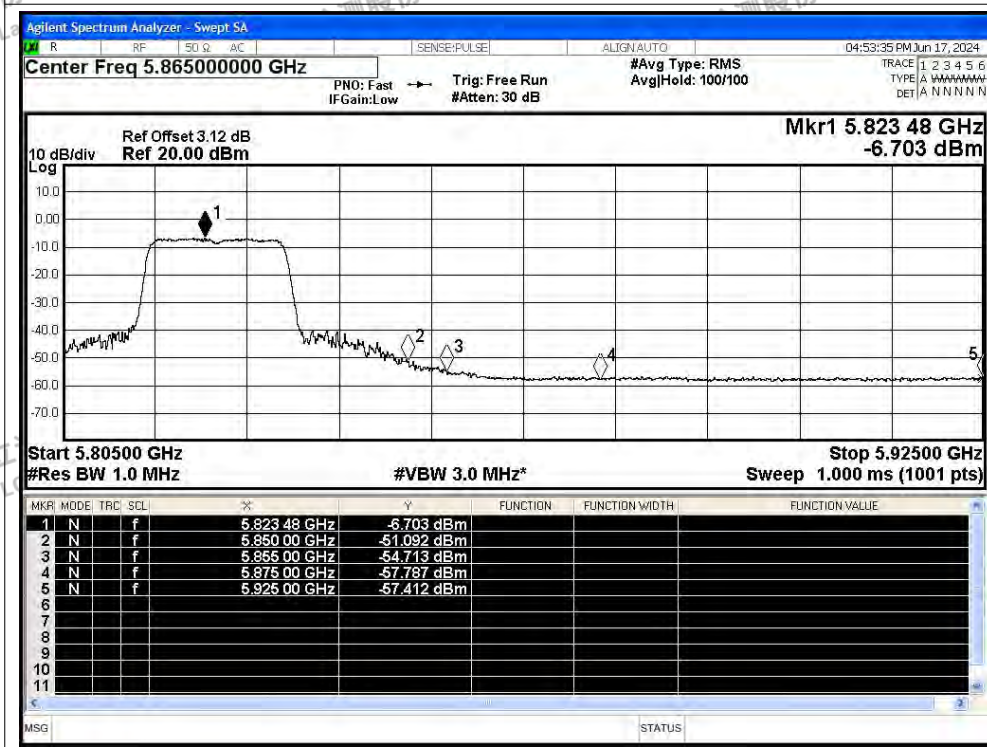

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant3 Peak

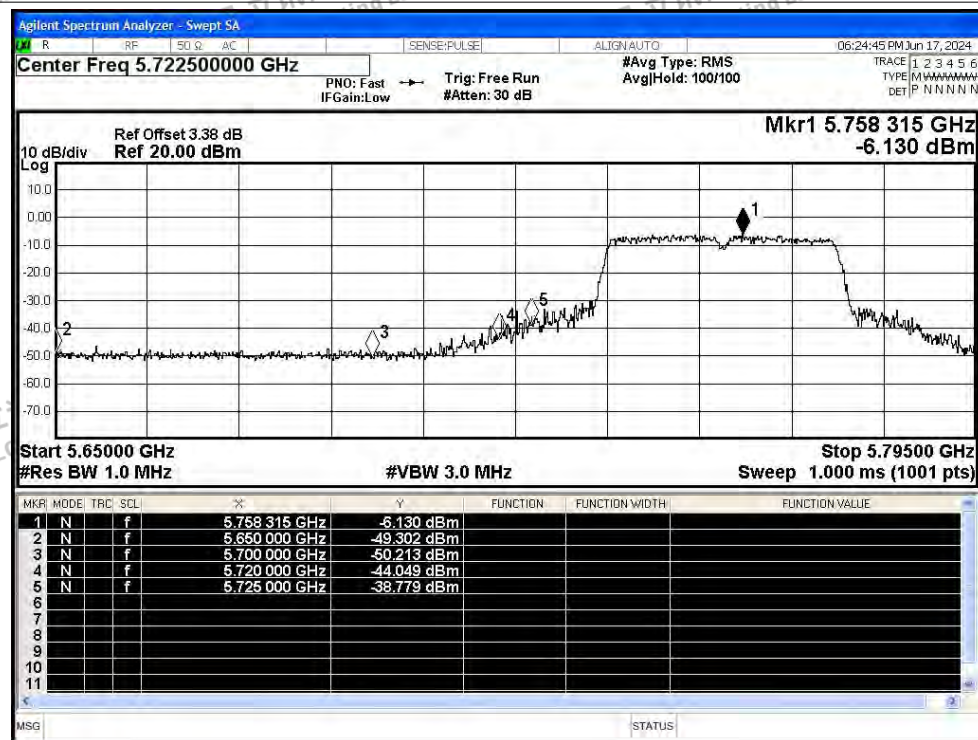

Restrict Band NVNT n40 5755MHz Ant3 Average

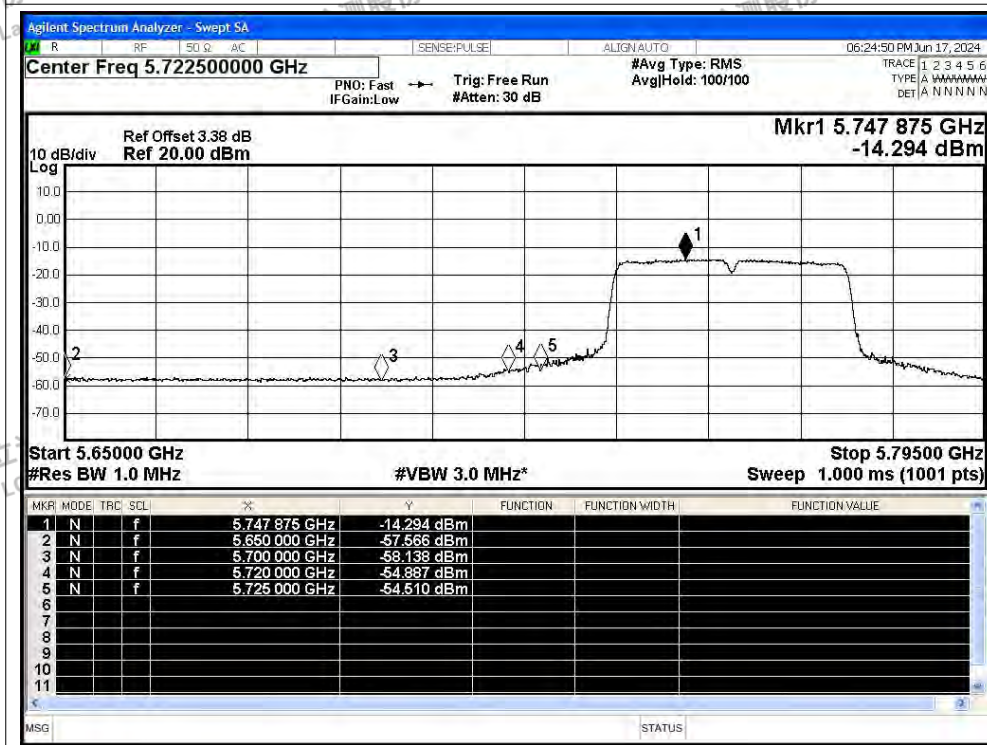

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant3 Peak

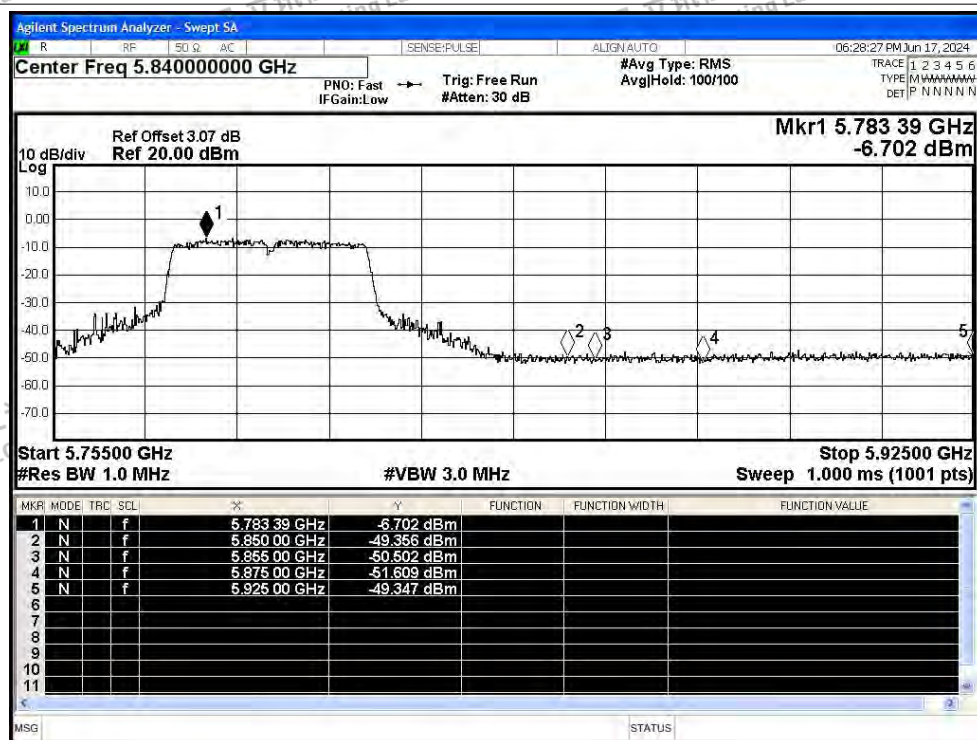

Restrict Band NVNT n40 5795MHz Ant3 Average

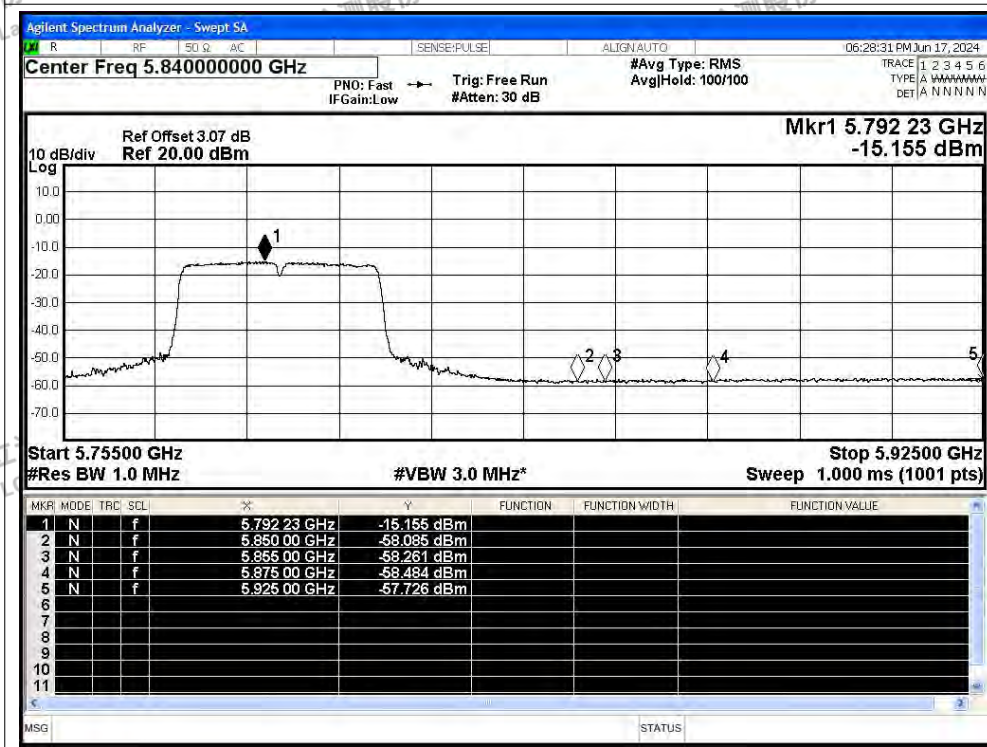

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant3 Peak



Restrict Band NVNT ac20 5745MHz Ant3 Average

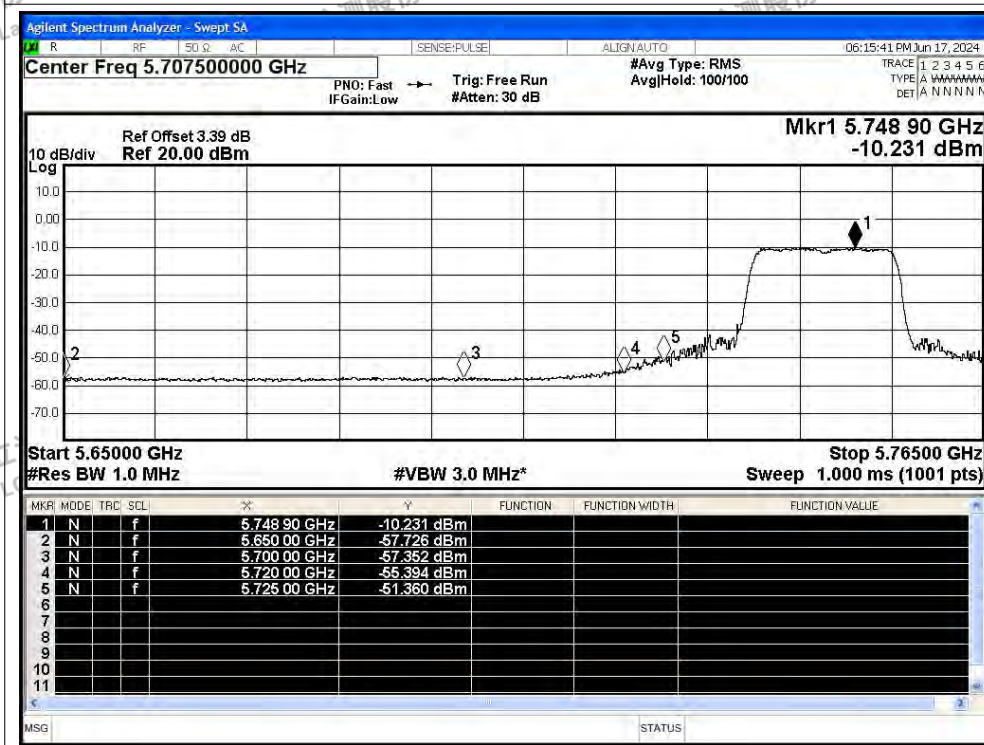

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant3 Peak

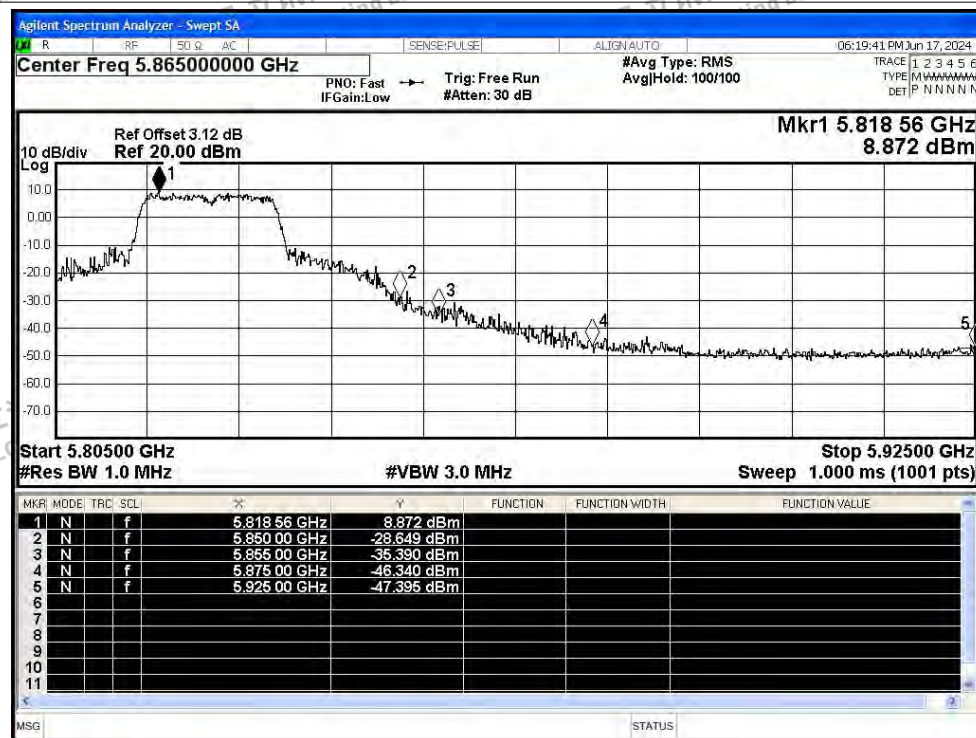

Restrict Band NVNT ac20 5825MHz Ant3 Average

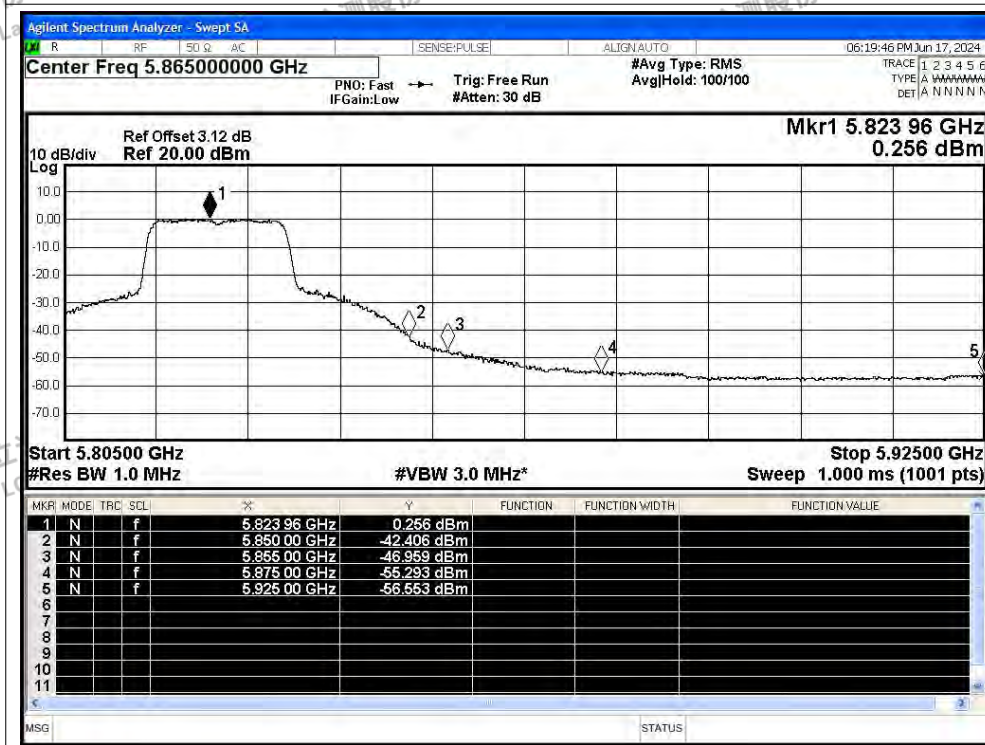

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant3 Peak

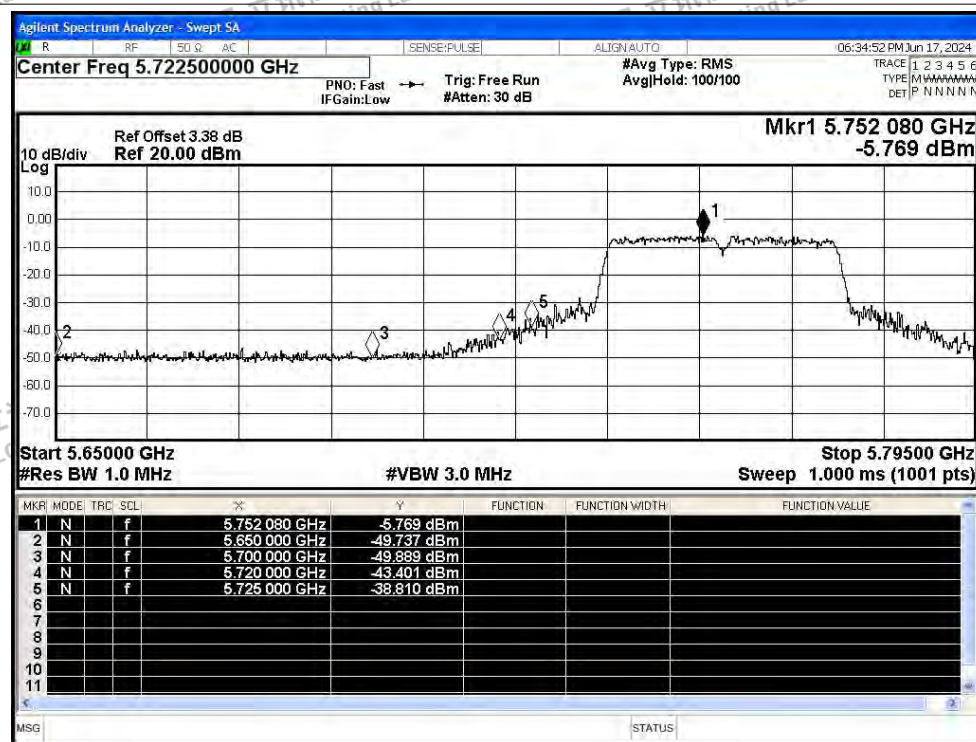

Restrict Band NVNT ac40 5755MHz Ant3 Average

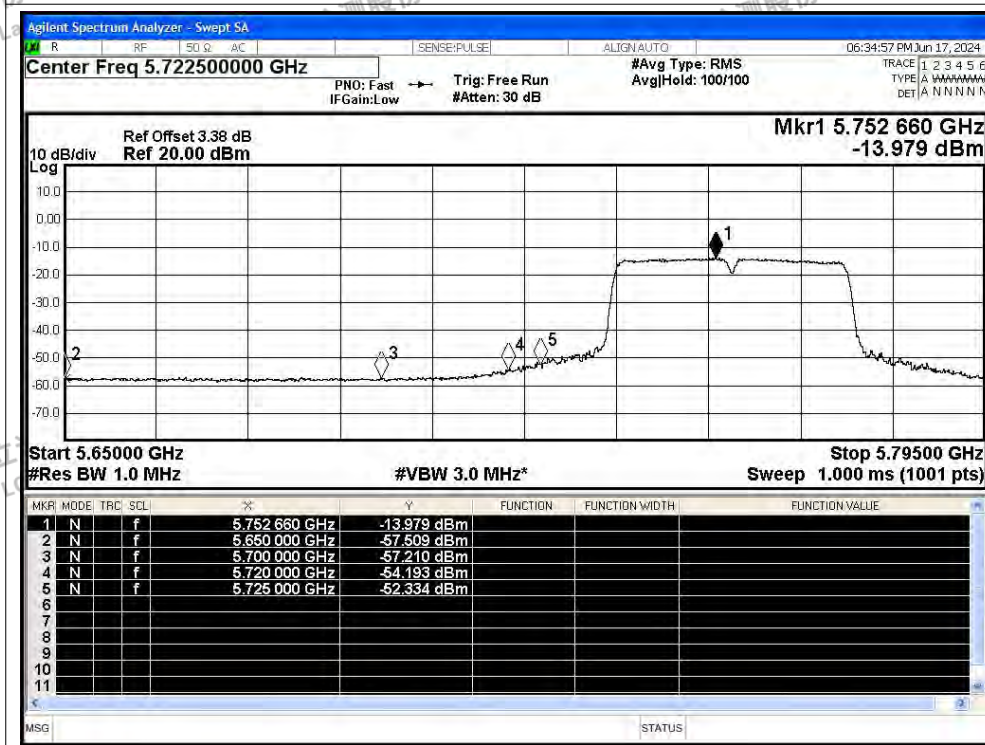

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant3 Peak

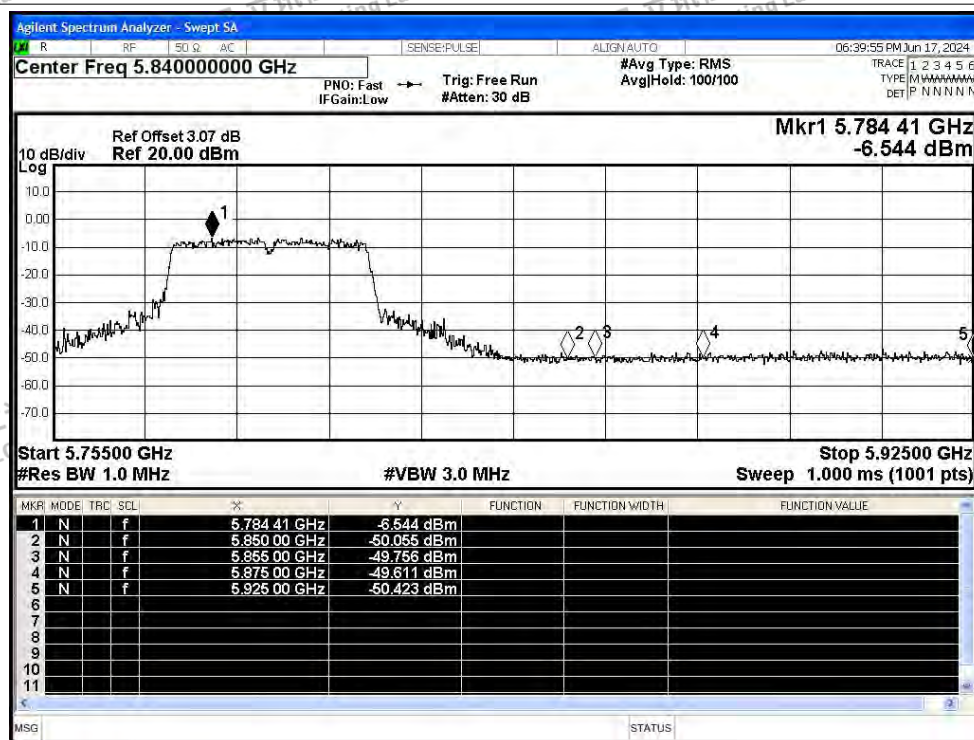

Restrict Band NVNT ac40 5795MHz Ant3 Average

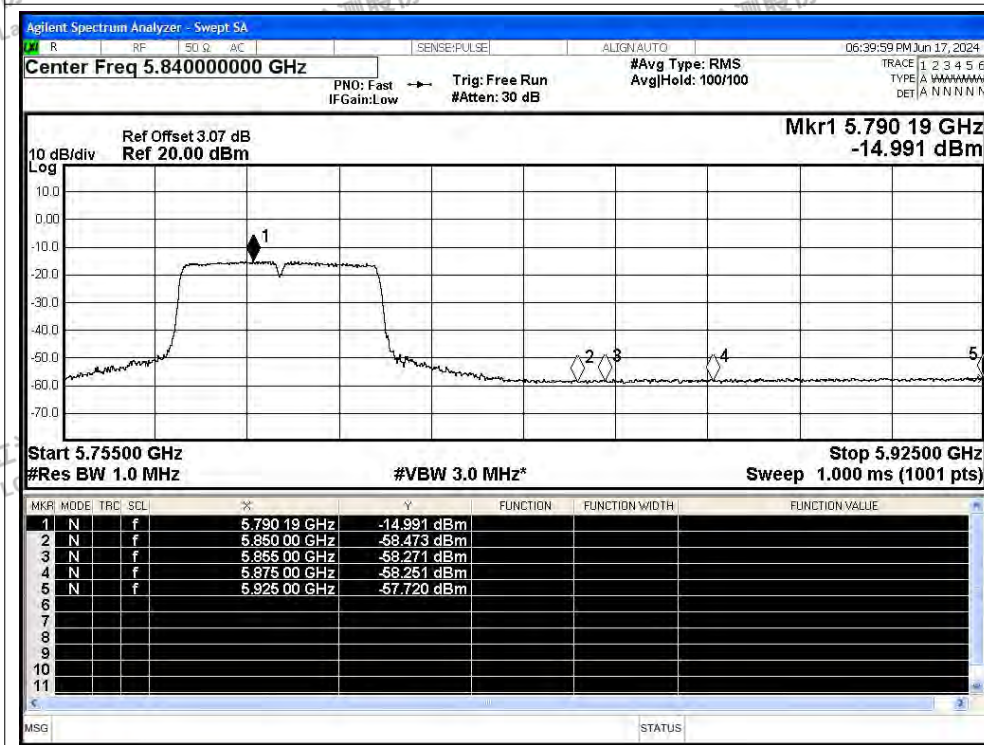

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

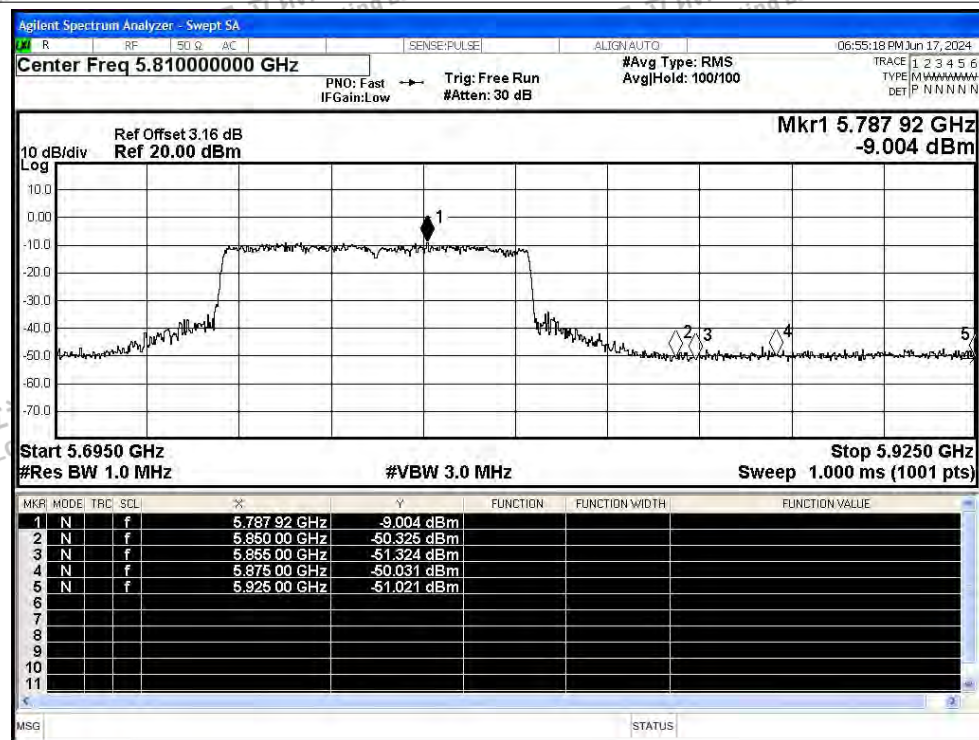

Restrict Band NVNT ac80 5775MHz Ant3 Average

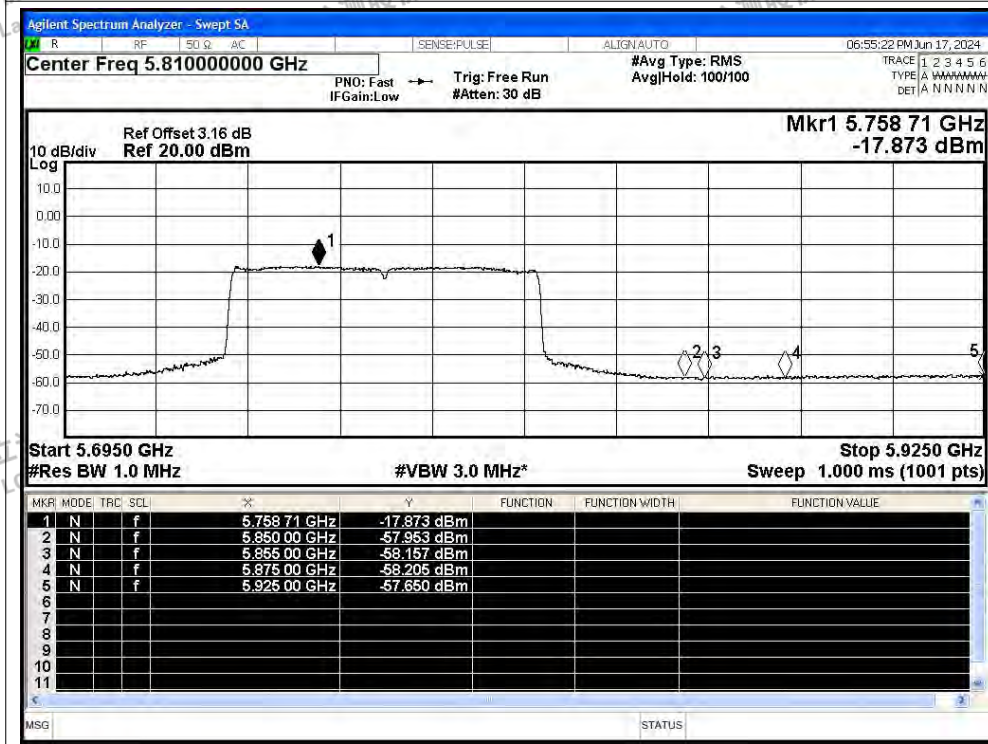

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant3 Peak

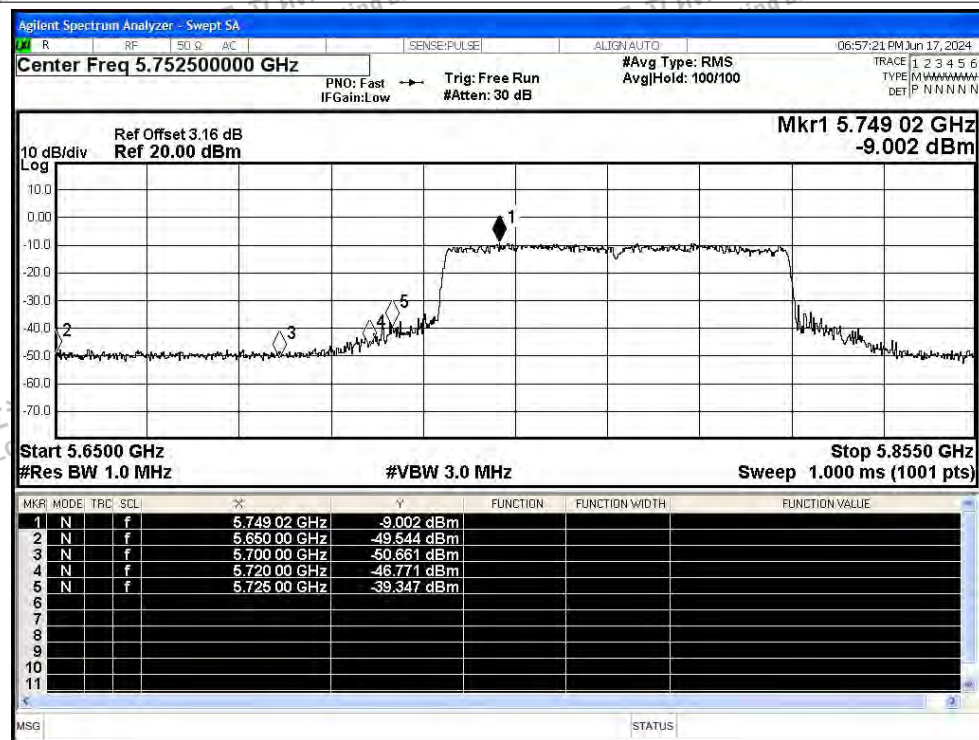

Restrict Band NVNT ac80 5775MHz Ant3 Average

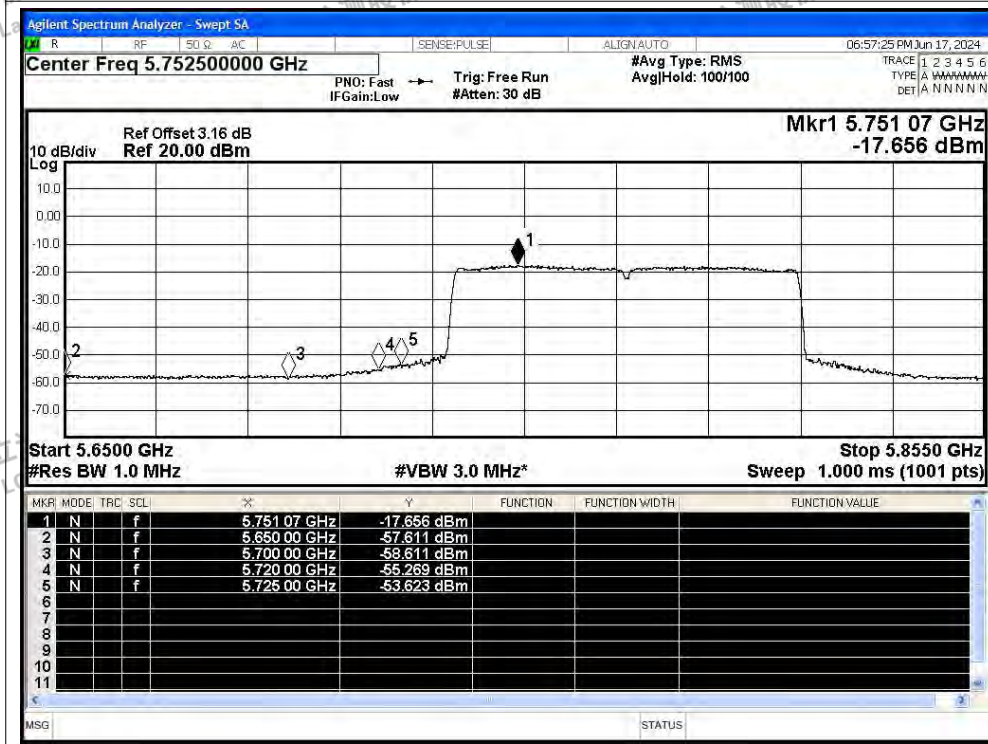

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant3 Peak

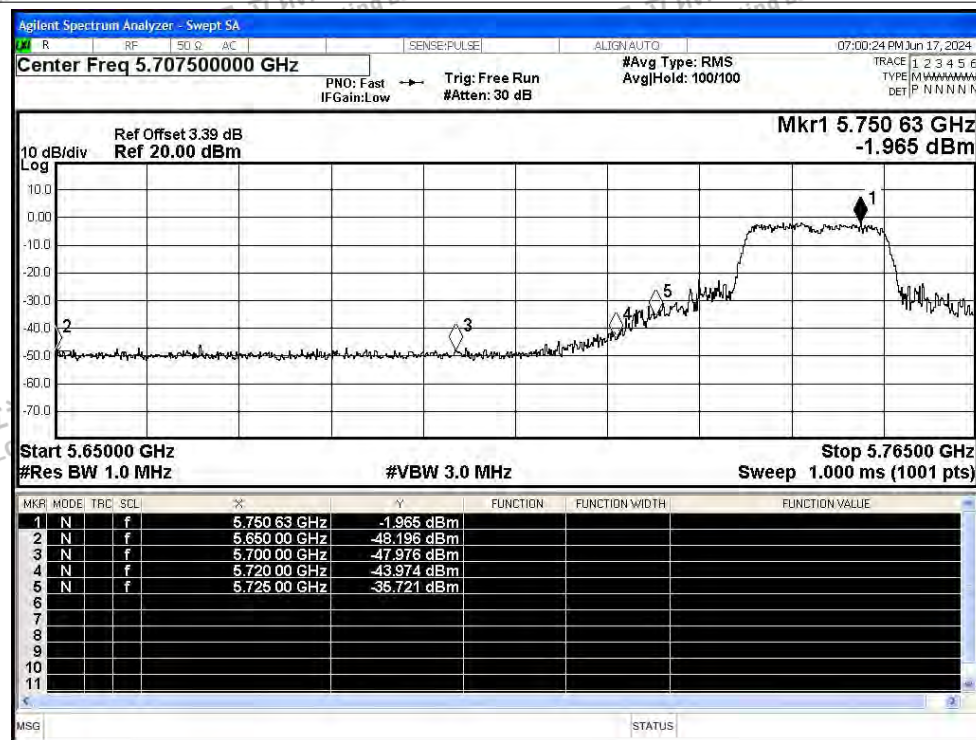

Restrict Band NVNT ax20 5745MHz Ant3 Average

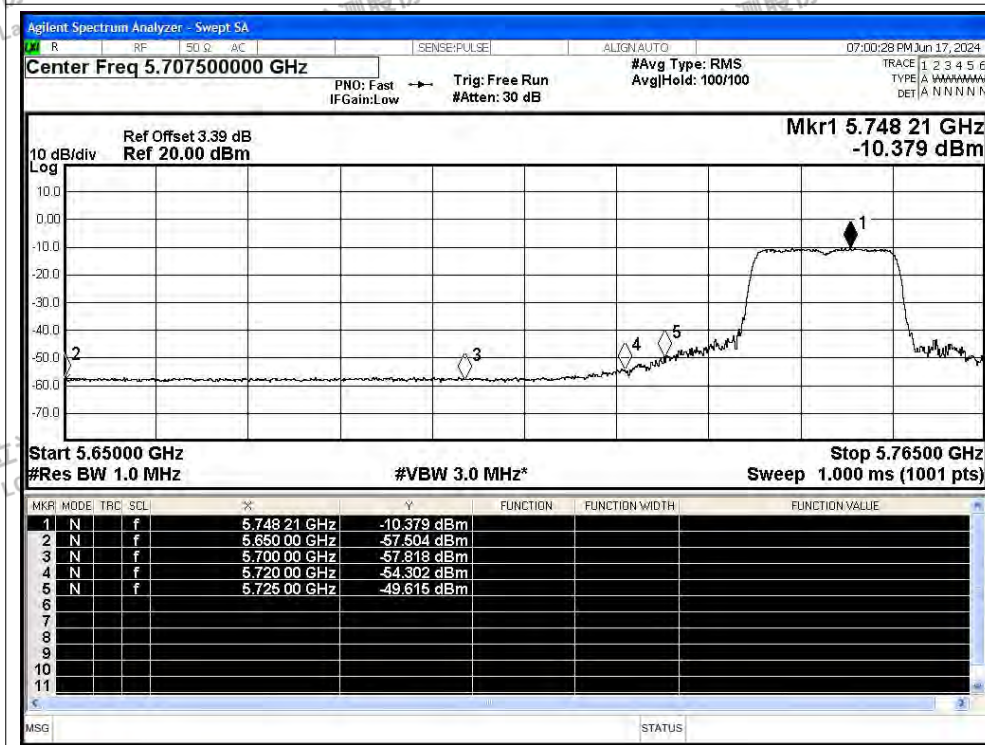

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant3 Peak

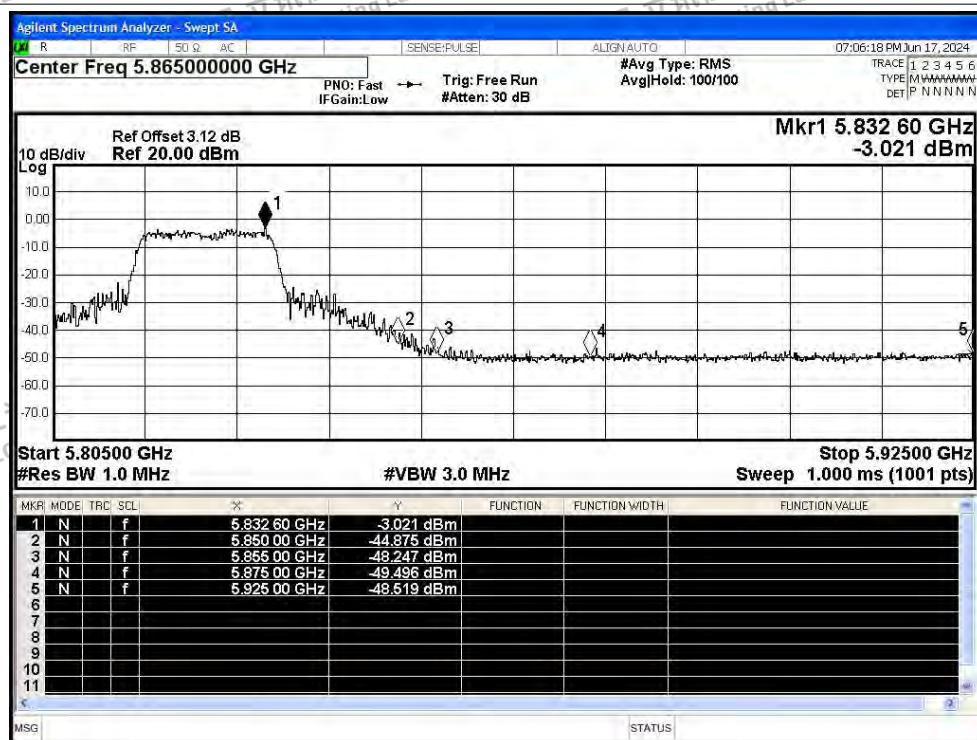

Restrict Band NVNT ax20 5825MHz Ant3 Average

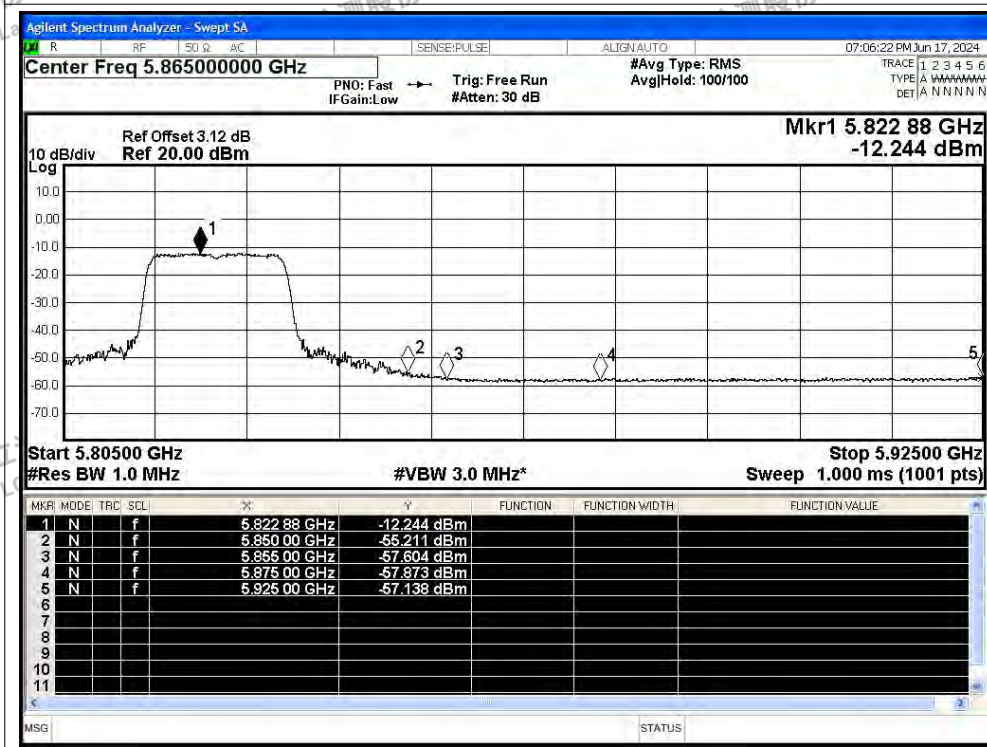

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant3 Peak

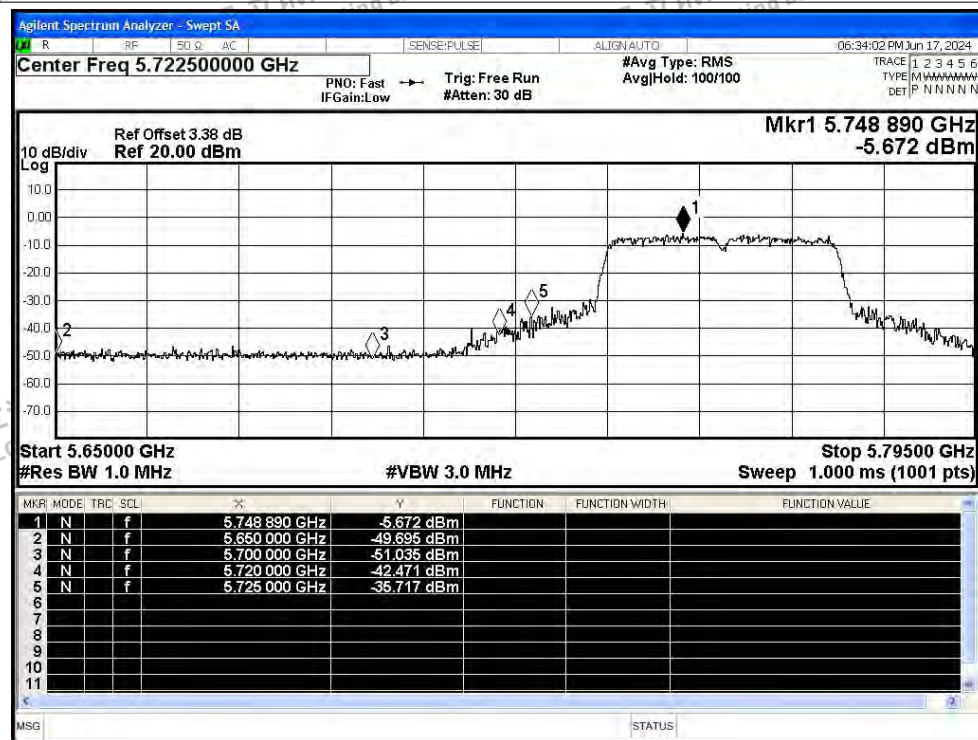

Restrict Band NVNT ax40 5755MHz Ant3 Average

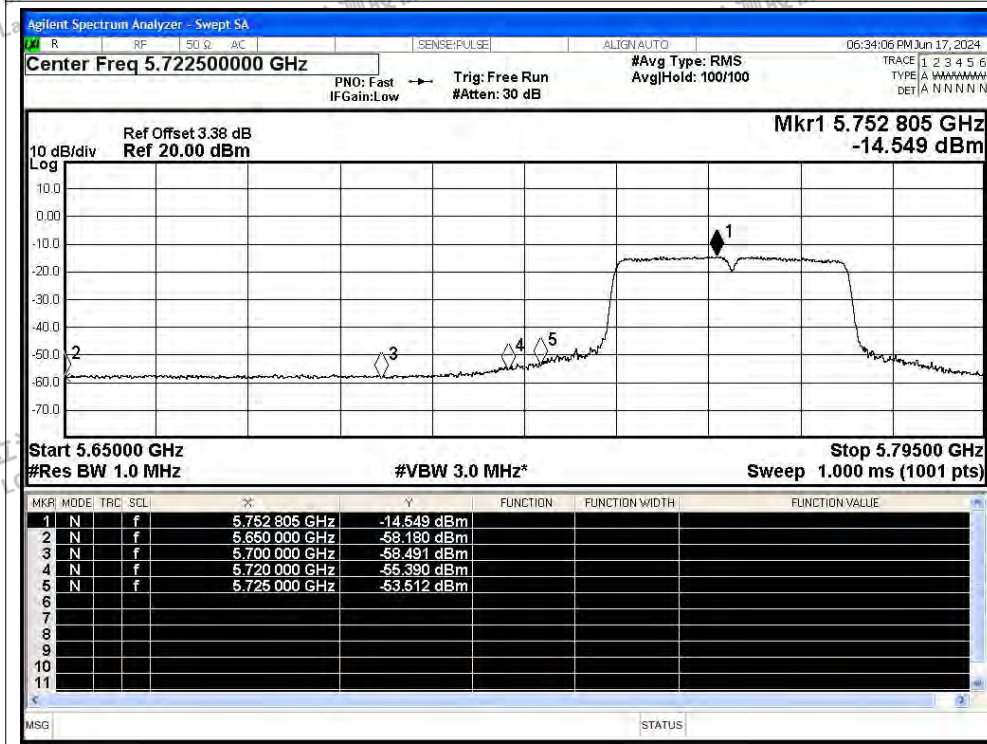

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant3 Peak

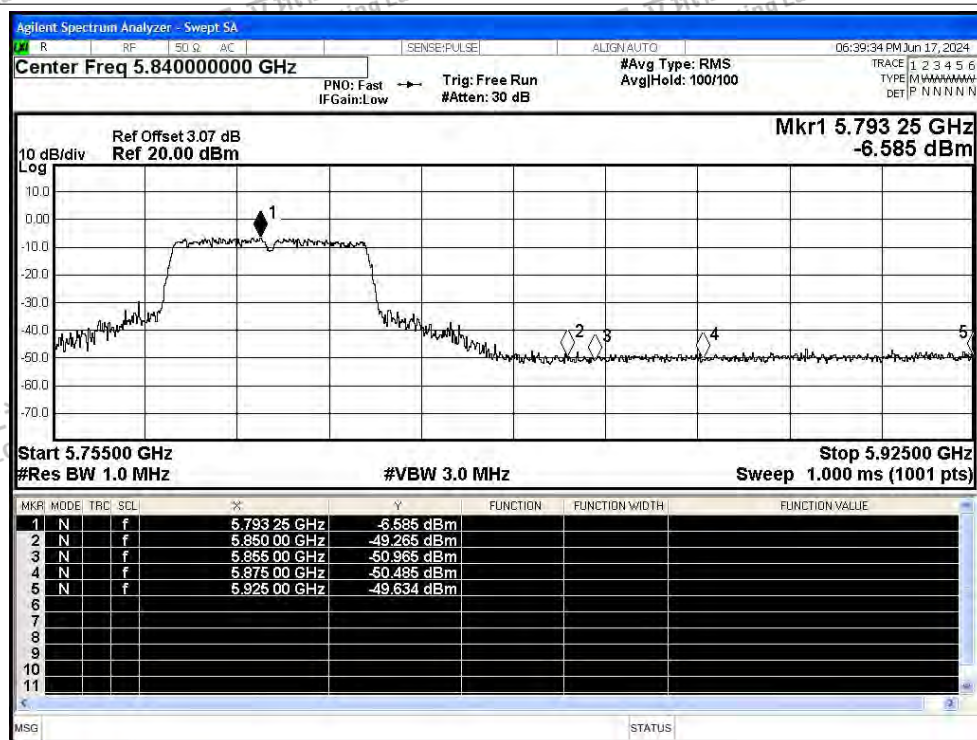

Restrict Band NVNT ax40 5795MHz Ant3 Average

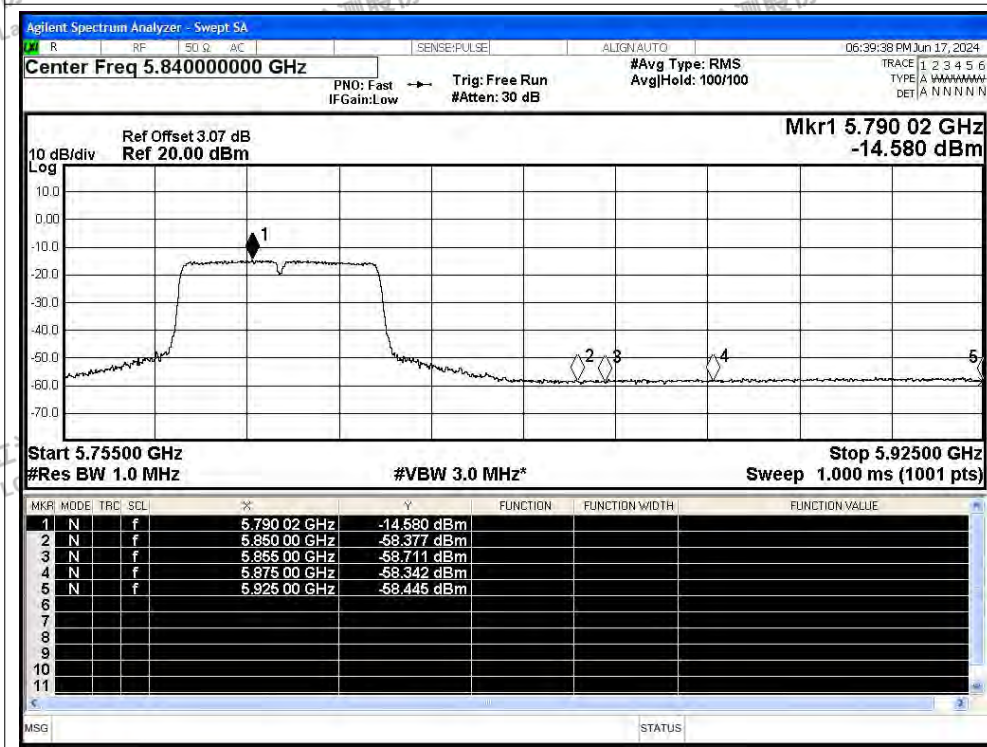

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant3 Peak

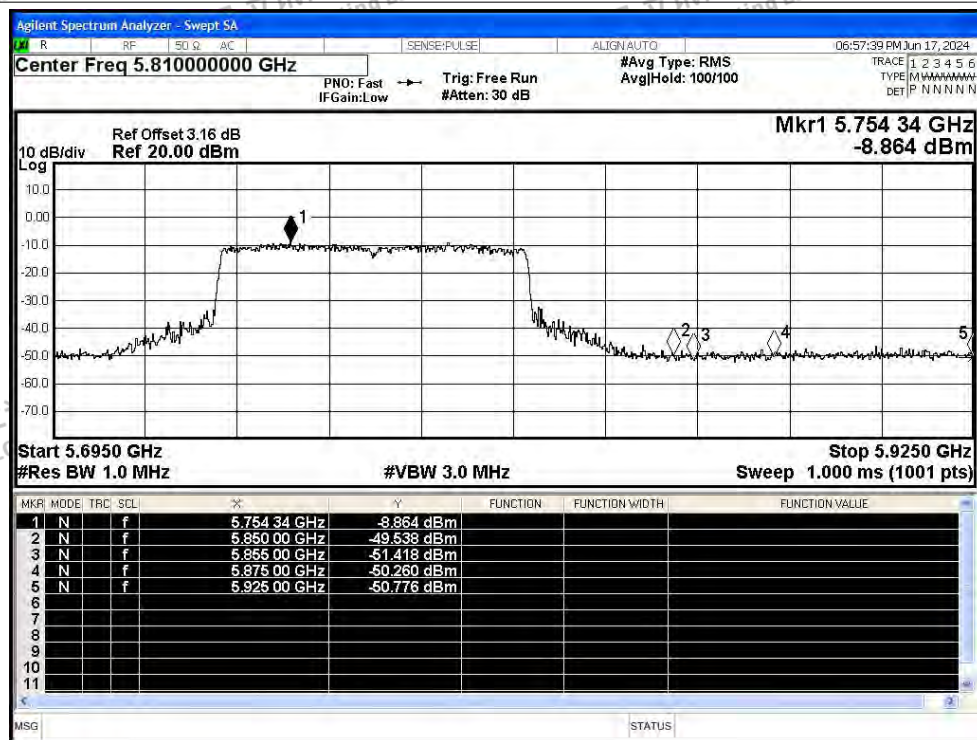

Restrict Band NVNT ax80 5775MHz Ant3 Average

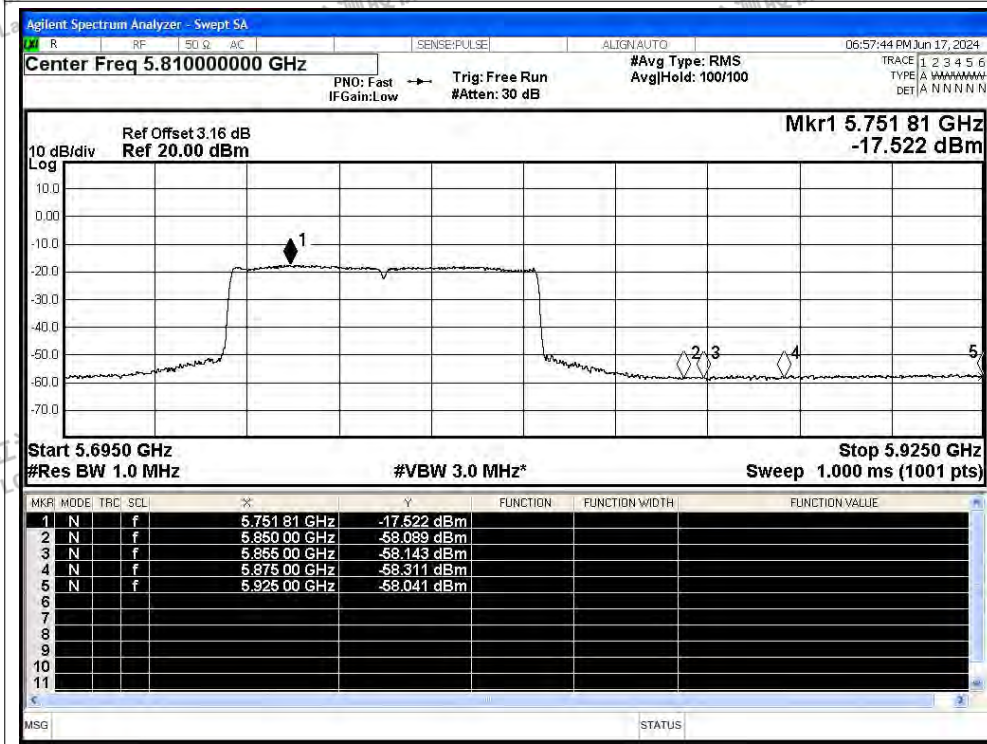

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant3 Peak

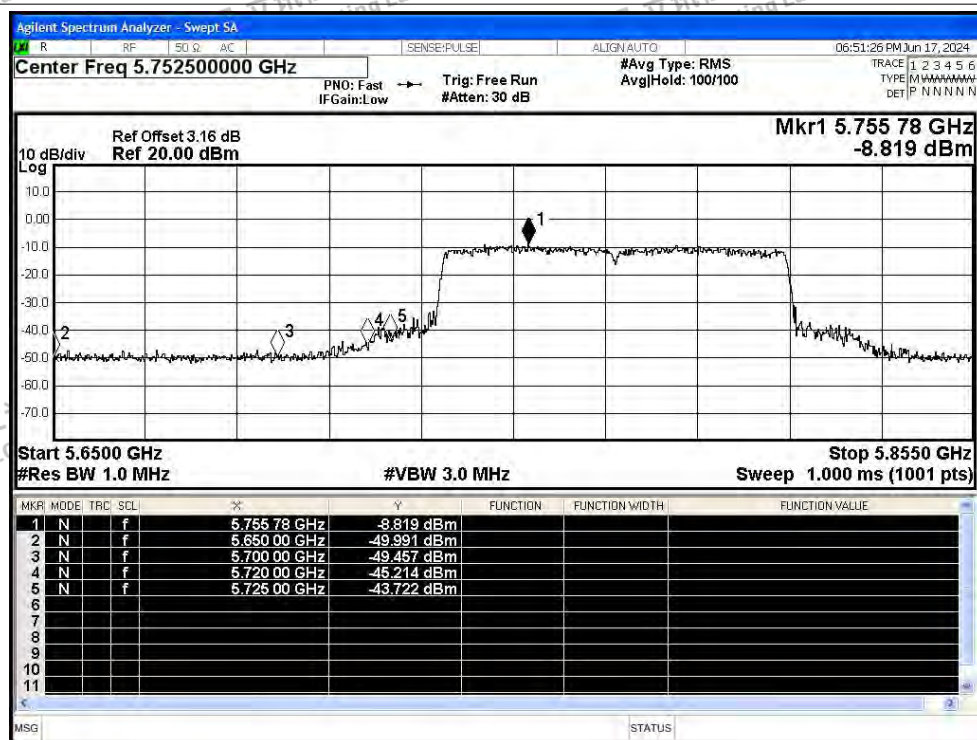

Restrict Band NVNT ax80 5775MHz Ant3 Average

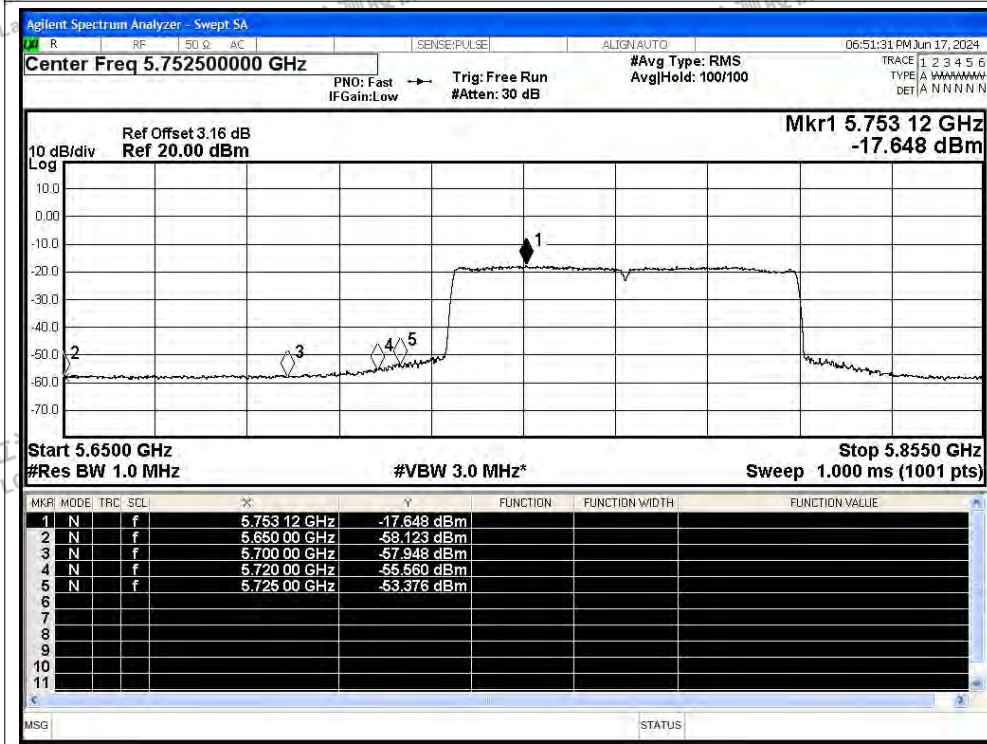

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	a	5745	Ant4	5650	-49.4	3.59	-	-45.81	Peak	-27	Pass
NVNT	a	5745	Ant4	5650	-57.62	3.59	0.24	-53.79	Average	-27	Pass
NVNT	a	5745	Ant4	5700	-50.05	3.59	-	-46.46	Peak	10	Pass
NVNT	a	5745	Ant4	5700	-58.18	3.59	0.24	-54.35	Average	10	Pass
NVNT	a	5745	Ant4	5720	-39.98	3.59	-	-36.39	Peak	15.6	Pass
NVNT	a	5745	Ant4	5720	-57.42	3.59	0.24	-53.59	Average	15.6	Pass
NVNT	a	5745	Ant4	5725	-34.91	3.59	-	-31.32	Peak	27	Pass
NVNT	a	5745	Ant4	5725	-53.12	3.59	0.24	-49.29	Average	27	Pass
NVNT	a	5825	Ant4	5850	-42.26	3.59	-	-38.67	Peak	27	Pass
NVNT	a	5825	Ant4	5850	-55.93	3.59	0.24	-52.10	Average	27	Pass
NVNT	a	5825	Ant4	5855	-49.46	3.59	-	-45.87	Peak	15.6	Pass
NVNT	a	5825	Ant4	5855	-57.72	3.59	0.24	-53.89	Average	15.6	Pass
NVNT	a	5825	Ant4	5875	-49.47	3.59	-	-45.88	Peak	10	Pass
NVNT	a	5825	Ant4	5875	-57.83	3.59	0.24	-54.00	Average	10	Pass
NVNT	a	5825	Ant4	5925	-49.74	3.59	-	-46.15	Peak	-27	Pass
NVNT	a	5825	Ant4	5925	-57.76	3.59	0.24	-53.93	Average	-27	Pass
NVNT	n20	5745	Ant4	5650	-50.28	3.59	-	-46.69	Peak	-27	Pass
NVNT	n20	5745	Ant4	5650	-57.85	3.59	0.28	-53.98	Average	-27	Pass
NVNT	n20	5745	Ant4	5700	-49.19	3.59	-	-45.60	Peak	10	Pass
NVNT	n20	5745	Ant4	5700	-57.09	3.59	0.28	-53.22	Average	10	Pass
NVNT	n20	5745	Ant4	5720	-41.04	3.59	-	-37.45	Peak	15.6	Pass
NVNT	n20	5745	Ant4	5720	-55.54	3.59	0.28	-51.67	Average	15.6	Pass
NVNT	n20	5745	Ant4	5725	-30.61	3.59	-	-27.02	Peak	27	Pass
NVNT	n20	5745	Ant4	5725	-51.11	3.59	0.28	-47.24	Average	27	Pass
NVNT	n20	5825	Ant4	5850	-42.33	3.59	-	-38.74	Peak	27	Pass
NVNT	n20	5825	Ant4	5850	-56.17	3.59	0.28	-52.30	Average	27	Pass
NVNT	n20	5825	Ant4	5855	-46.88	3.59	-	-43.29	Peak	15.6	Pass
NVNT	n20	5825	Ant4	5855	-57.01	3.59	0.28	-53.14	Average	15.6	Pass
NVNT	n20	5825	Ant4	5875	-49.42	3.59	-	-45.83	Peak	10	Pass
NVNT	n20	5825	Ant4	5875	-58.27	3.59	0.28	-54.40	Average	10	Pass
NVNT	n20	5825	Ant4	5925	-47.45	3.59	-	-43.86	Peak	-27	Pass
NVNT	n20	5825	Ant4	5925	-57.57	3.59	0.28	-53.70	Average	-27	Pass
NVNT	n40	5755	Ant4	5650	-49.71	3.59	-	-46.12	Peak	-27	Pass
NVNT	n40	5755	Ant4	5650	-58.01	3.59	0.12	-54.30	Average	-27	Pass
NVNT	n40	5755	Ant4	5700	-48.96	3.59	-	-45.37	Peak	10	Pass
NVNT	n40	5755	Ant4	5700	-58.24	3.59	0.12	-54.53	Average	10	Pass
NVNT	n40	5755	Ant4	5720	-41.62	3.59	-	-38.03	Peak	15.6	Pass





NVNT	n40	5755	Ant4	5720	-54.89	3.59	0.12	-51.18	Average	15.6	Pass
NVNT	n40	5755	Ant4	5725	-40.52	3.59	-	-36.93	Peak	27	Pass
NVNT	n40	5755	Ant4	5725	-53.05	3.59	0.12	-49.34	Average	27	Pass
NVNT	n40	5795	Ant4	5850	-51.64	3.59	-	-48.05	Peak	27	Pass
NVNT	n40	5795	Ant4	5850	-58.48	3.59	0.12	-54.77	Average	27	Pass
NVNT	n40	5795	Ant4	5855	-51.13	3.59	-	-47.54	Peak	15.6	Pass
NVNT	n40	5795	Ant4	5855	-58.88	3.59	0.12	-55.17	Average	15.6	Pass
NVNT	n40	5795	Ant4	5875	-49.84	3.59	-	-46.25	Peak	10	Pass
NVNT	n40	5795	Ant4	5875	-57.94	3.59	0.12	-54.23	Average	10	Pass
NVNT	n40	5795	Ant4	5925	-50	3.59	-	-46.41	Peak	-27	Pass
NVNT	n40	5795	Ant4	5925	-57.43	3.59	0.12	-53.72	Average	-27	Pass
NVNT	ac20	5745	Ant4	5650	-49.82	3.59	-	-46.23	Peak	-27	Pass
NVNT	ac20	5745	Ant4	5650	-57.42	3.59	0.28	-53.55	Average	-27	Pass
NVNT	ac20	5745	Ant4	5700	-50.96	3.59	-	-47.37	Peak	10	Pass
NVNT	ac20	5745	Ant4	5700	-57.58	3.59	0.28	-53.71	Average	10	Pass
NVNT	ac20	5745	Ant4	5720	-39.78	3.59	-	-36.19	Peak	15.6	Pass
NVNT	ac20	5745	Ant4	5720	-55.31	3.59	0.28	-51.44	Average	15.6	Pass
NVNT	ac20	5745	Ant4	5725	-37.53	3.59	-	-33.94	Peak	27	Pass
NVNT	ac20	5745	Ant4	5725	-49.96	3.59	0.28	-46.09	Average	27	Pass
NVNT	ac20	5825	Ant4	5850	-42.62	3.59	-	-39.03	Peak	27	Pass
NVNT	ac20	5825	Ant4	5850	-56.43	3.59	0.28	-52.56	Average	27	Pass
NVNT	ac20	5825	Ant4	5855	-46.78	3.59	-	-43.19	Peak	15.6	Pass
NVNT	ac20	5825	Ant4	5855	-57.47	3.59	0.28	-53.60	Average	15.6	Pass
NVNT	ac20	5825	Ant4	5875	-49.02	3.59	-	-45.43	Peak	10	Pass
NVNT	ac20	5825	Ant4	5875	-58.03	3.59	0.28	-54.16	Average	10	Pass
NVNT	ac20	5825	Ant4	5925	-50.88	3.59	-	-47.29	Peak	-27	Pass
NVNT	ac20	5825	Ant4	5925	-57.61	3.59	0.28	-53.74	Average	-27	Pass
NVNT	ac40	5755	Ant4	5650	-47.37	3.59	-	-43.78	Peak	-27	Pass
NVNT	ac40	5755	Ant4	5650	-57.94	3.59	0.12	-54.23	Average	-27	Pass
NVNT	ac40	5755	Ant4	5700	-49.39	3.59	-	-45.80	Peak	10	Pass
NVNT	ac40	5755	Ant4	5700	-57.99	3.59	0.12	-54.28	Average	10	Pass
NVNT	ac40	5755	Ant4	5720	-47.36	3.59	-	-43.77	Peak	15.6	Pass
NVNT	ac40	5755	Ant4	5720	-56.25	3.59	0.12	-52.54	Average	15.6	Pass
NVNT	ac40	5755	Ant4	5725	-40.41	3.59	-	-36.82	Peak	27	Pass
NVNT	ac40	5755	Ant4	5725	-54.5	3.59	0.12	-50.79	Average	27	Pass
NVNT	ac40	5795	Ant4	5850	-50.6	3.59	-	-47.01	Peak	27	Pass
NVNT	ac40	5795	Ant4	5850	-58.72	3.59	0.12	-55.01	Average	27	Pass
NVNT	ac40	5795	Ant4	5855	-50.73	3.59	-	-47.14	Peak	15.6	Pass
NVNT	ac40	5795	Ant4	5855	-58.61	3.59	0.12	-54.90	Average	15.6	Pass
NVNT	ac40	5795	Ant4	5875	-50.58	3.59	-	-46.99	Peak	10	Pass
NVNT	ac40	5795	Ant4	5875	-58	3.59	0.12	-54.29	Average	10	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5795	Ant4	5925	-48.34	3.59	-	-44.75	Peak	-27	Pass
NVNT	ac40	5795	Ant4	5925	-57.57	3.59	0.12	-53.86	Average	-27	Pass
NVNT	ac80	5775	Ant4	5850	-51.25	3.59	-	-47.66	Peak	27	Pass
NVNT	ac80	5775	Ant4	5850	-57.8	3.59	0.25	-53.96	Average	27	Pass
NVNT	ac80	5775	Ant4	5855	-49.87	3.59	-	-46.28	Peak	15.6	Pass
NVNT	ac80	5775	Ant4	5855	-58.56	3.59	0.25	-54.72	Average	15.6	Pass
NVNT	ac80	5775	Ant4	5875	-50.74	3.59	-	-47.15	Peak	10	Pass
NVNT	ac80	5775	Ant4	5875	-58.67	3.59	0.25	-54.83	Average	10	Pass
NVNT	ac80	5775	Ant4	5925	-50.21	3.59	-	-46.62	Peak	-27	Pass
NVNT	ac80	5775	Ant4	5925	-57.59	3.59	0.25	-53.75	Average	-27	Pass
NVNT	ac80	5775	Ant4	5650	-49.73	3.59	-	-46.14	Peak	-27	Pass
NVNT	ac80	5775	Ant4	5650	-57.79	3.59	0.25	-53.95	Average	-27	Pass
NVNT	ac80	5775	Ant4	5700	-50.49	3.59	-	-46.90	Peak	10	Pass
NVNT	ac80	5775	Ant4	5700	-58.05	3.59	0.25	-54.21	Average	10	Pass
NVNT	ac80	5775	Ant4	5720	-44.18	3.59	-	-40.59	Peak	15.6	Pass
NVNT	ac80	5775	Ant4	5720	-55.72	3.59	0.25	-51.88	Average	15.6	Pass
NVNT	ac80	5775	Ant4	5725	-41.8	3.59	-	-38.21	Peak	27	Pass
NVNT	ac80	5775	Ant4	5725	-55.03	3.59	0.25	-51.19	Average	27	Pass
NVNT	ax20	5745	Ant4	5650	-47.87	3.59	-	-44.28	Peak	-27	Pass
NVNT	ax20	5745	Ant4	5650	-58.17	3.59	0.28	-54.30	Average	-27	Pass
NVNT	ax20	5745	Ant4	5700	-48.65	3.59	-	-45.06	Peak	10	Pass
NVNT	ax20	5745	Ant4	5700	-57.31	3.59	0.28	-53.44	Average	10	Pass
NVNT	ax20	5745	Ant4	5720	-39.95	3.59	-	-36.36	Peak	15.6	Pass
NVNT	ax20	5745	Ant4	5720	-54.84	3.59	0.28	-50.97	Average	15.6	Pass
NVNT	ax20	5745	Ant4	5725	-38.54	3.59	-	-34.95	Peak	27	Pass
NVNT	ax20	5745	Ant4	5725	-48.97	3.59	0.28	-45.10	Average	27	Pass
NVNT	ax20	5825	Ant4	5850	-42.56	3.59	-	-38.97	Peak	27	Pass
NVNT	ax20	5825	Ant4	5850	-56.57	3.59	0.28	-52.70	Average	27	Pass
NVNT	ax20	5825	Ant4	5855	-48.77	3.59	-	-45.18	Peak	15.6	Pass
NVNT	ax20	5825	Ant4	5855	-57.5	3.59	0.28	-53.63	Average	15.6	Pass
NVNT	ax20	5825	Ant4	5875	-50.41	3.59	-	-46.82	Peak	10	Pass
NVNT	ax20	5825	Ant4	5875	-58.08	3.59	0.28	-54.21	Average	10	Pass
NVNT	ax20	5825	Ant4	5925	-49.6	3.59	-	-46.01	Peak	-27	Pass
NVNT	ax20	5825	Ant4	5925	-58.07	3.59	0.28	-54.20	Average	-27	Pass
NVNT	ax40	5755	Ant4	5650	-49.82	3.59	-	-46.23	Peak	-27	Pass
NVNT	ax40	5755	Ant4	5650	-57.19	3.59	0.12	-53.48	Average	-27	Pass
NVNT	ax40	5755	Ant4	5700	-49.52	3.59	-	-45.93	Peak	10	Pass
NVNT	ax40	5755	Ant4	5700	-58.35	3.59	0.12	-54.64	Average	10	Pass
NVNT	ax40	5755	Ant4	5720	-43.43	3.59	-	-39.84	Peak	15.6	Pass
NVNT	ax40	5755	Ant4	5720	-54.99	3.59	0.12	-51.28	Average	15.6	Pass
NVNT	ax40	5755	Ant4	5725	-40.15	3.59	-	-36.56	Peak	27	Pass






NVNT	ax40	5755	Ant4	5725	-52.07	3.59	0.12	-48.36	Average	27	Pass
NVNT	ax40	5795	Ant4	5850	-51.25	3.59	-	-47.66	Peak	27	Pass
NVNT	ax40	5795	Ant4	5850	-58.46	3.59	0.12	-54.75	Average	27	Pass
NVNT	ax40	5795	Ant4	5855	-49.74	3.59	-	-46.15	Peak	15.6	Pass
NVNT	ax40	5795	Ant4	5855	-58.39	3.59	0.12	-54.68	Average	15.6	Pass
NVNT	ax40	5795	Ant4	5875	-48.46	3.59	-	-44.87	Peak	10	Pass
NVNT	ax40	5795	Ant4	5875	-58.46	3.59	0.12	-54.75	Average	10	Pass
NVNT	ax40	5795	Ant4	5925	-48.38	3.59	-	-44.79	Peak	-27	Pass
NVNT	ax40	5795	Ant4	5925	-57.53	3.59	0.12	-53.82	Average	-27	Pass
NVNT	ax80	5775	Ant4	5850	-50.31	3.59	-	-46.72	Peak	27	Pass
NVNT	ax80	5775	Ant4	5850	-58.48	3.59	0.25	-54.64	Average	27	Pass
NVNT	ax80	5775	Ant4	5855	-49.97	3.59	-	-46.38	Peak	15.6	Pass
NVNT	ax80	5775	Ant4	5855	-58.42	3.59	0.25	-54.58	Average	15.6	Pass
NVNT	ax80	5775	Ant4	5875	-49.67	3.59	-	-46.08	Peak	10	Pass
NVNT	ax80	5775	Ant4	5875	-58.26	3.59	0.25	-54.42	Average	10	Pass
NVNT	ax80	5775	Ant4	5925	-48.7	3.59	-	-45.11	Peak	-27	Pass
NVNT	ax80	5775	Ant4	5925	-57.49	3.59	0.25	-53.65	Average	-27	Pass
NVNT	ax80	5775	Ant4	5650	-49.39	3.59	-	-45.80	Peak	-27	Pass
NVNT	ax80	5775	Ant4	5650	-58.44	3.59	0.25	-54.60	Average	-27	Pass
NVNT	ax80	5775	Ant4	5700	-49.24	3.59	-	-45.65	Peak	10	Pass
NVNT	ax80	5775	Ant4	5700	-57.64	3.59	0.25	-53.80	Average	10	Pass
NVNT	ax80	5775	Ant4	5720	-43.87	3.59	-	-40.28	Peak	15.6	Pass
NVNT	ax80	5775	Ant4	5720	-55.71	3.59	0.25	-51.87	Average	15.6	Pass
NVNT	ax80	5775	Ant4	5725	-40.83	3.59	-	-37.24	Peak	27	Pass
NVNT	ax80	5775	Ant4	5725	-54.87	3.59	0.25	-51.03	Average	27	Pass





Test Graphs

Restrict Band NVNT a 5745MHz Ant4 Peak

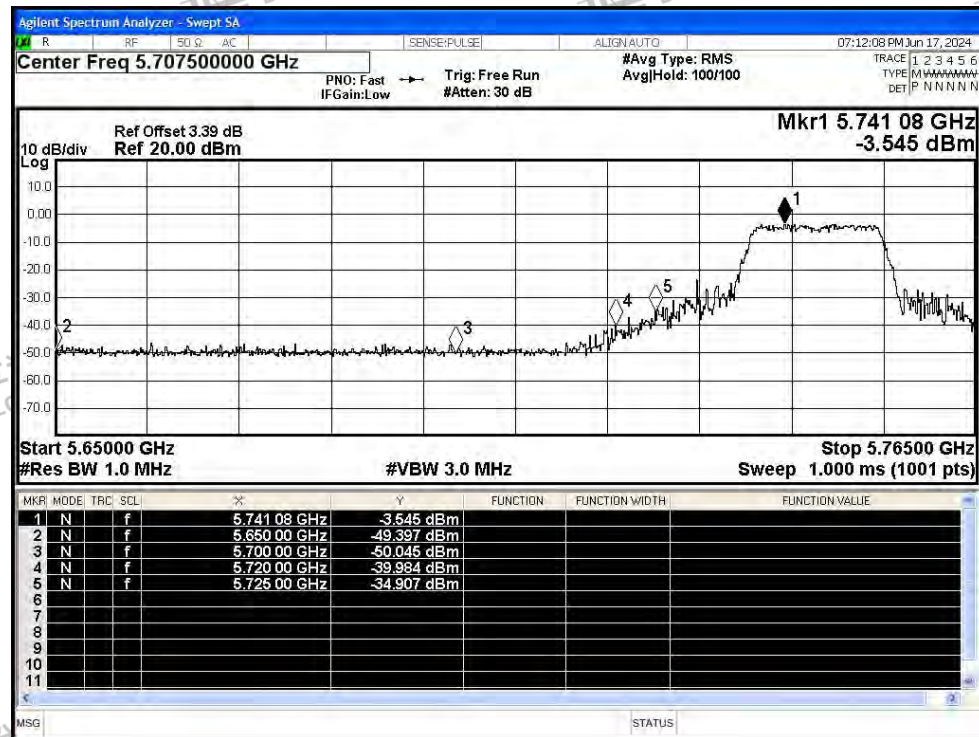

Restrict Band NVNT a 5745MHz Ant4 Average



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5825MHz Ant4 Peak



Restrict Band NVNT a 5825MHz Ant4 Average

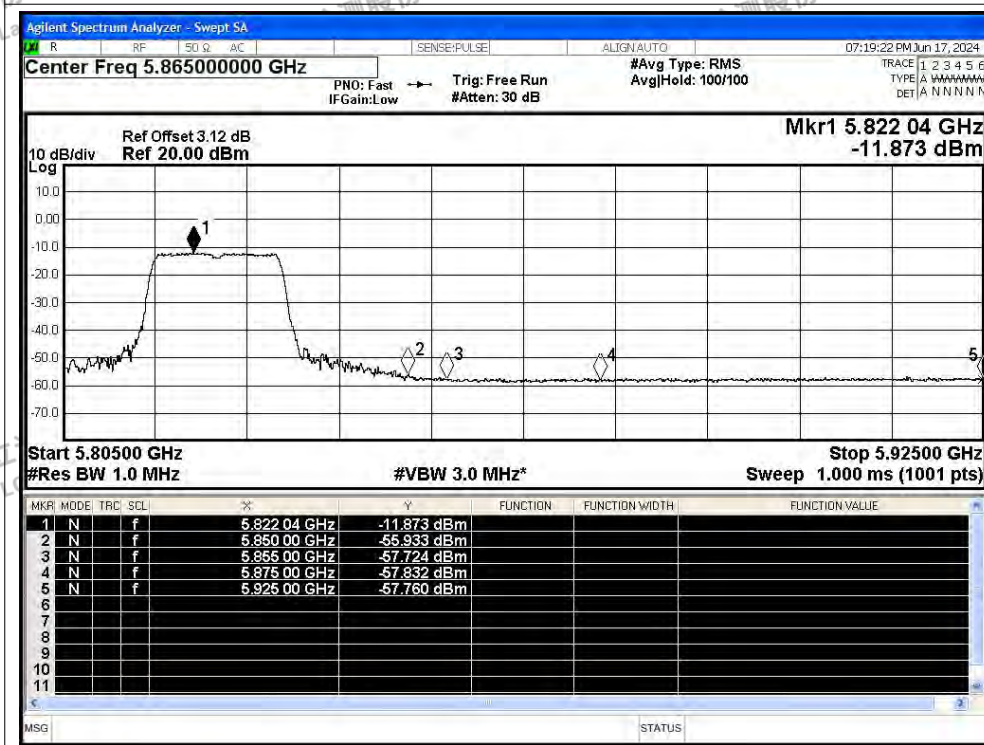

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5745MHz Ant4 Peak



Restrict Band NVNT n20 5745MHz Ant4 Average

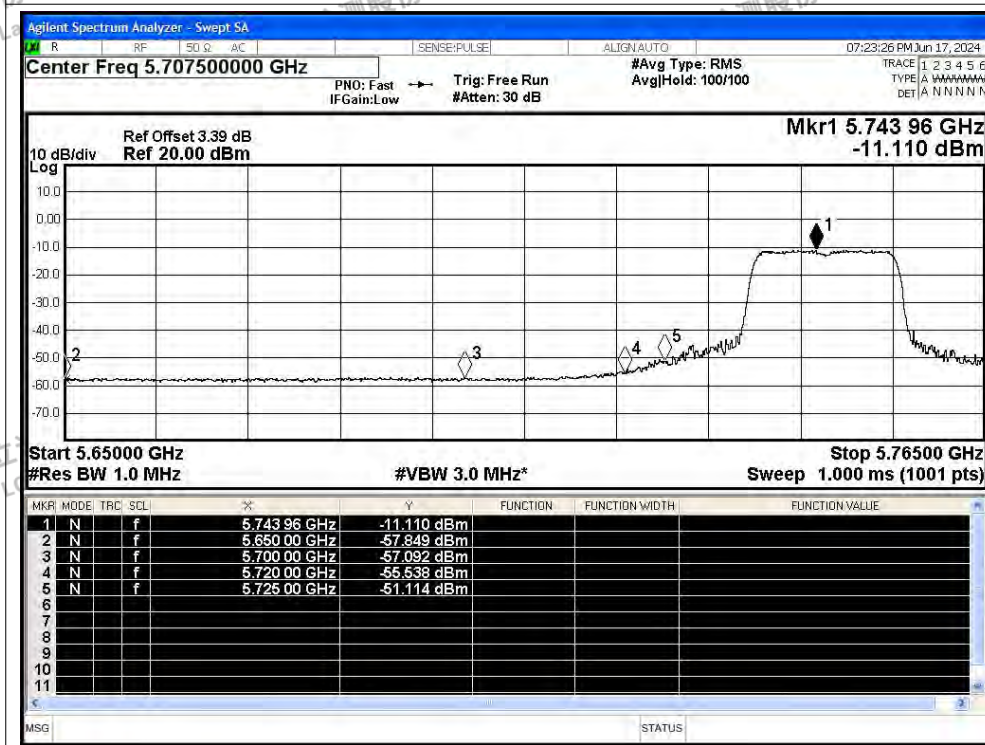

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5825MHz Ant4 Peak

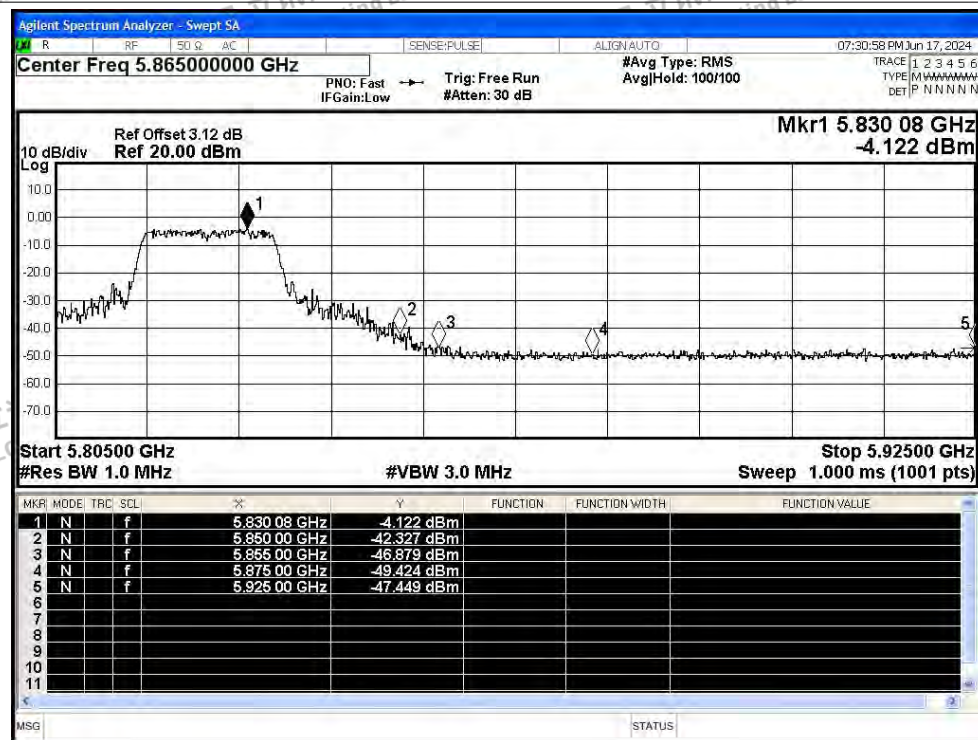

Restrict Band NVNT n20 5825MHz Ant4 Average

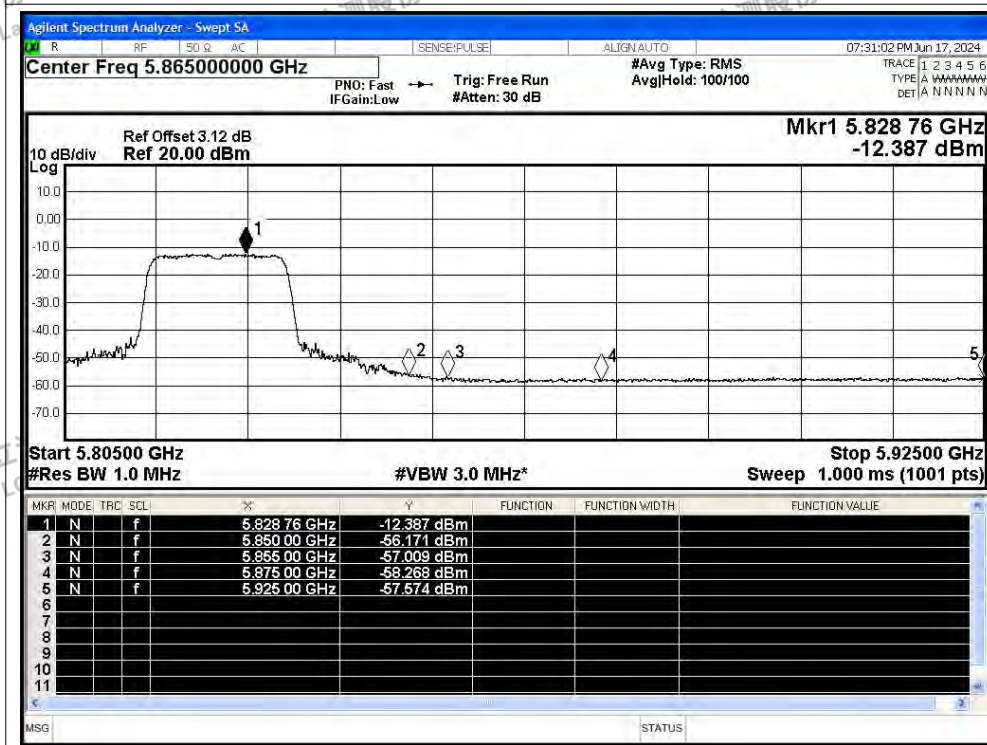

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5755MHz Ant4 Peak

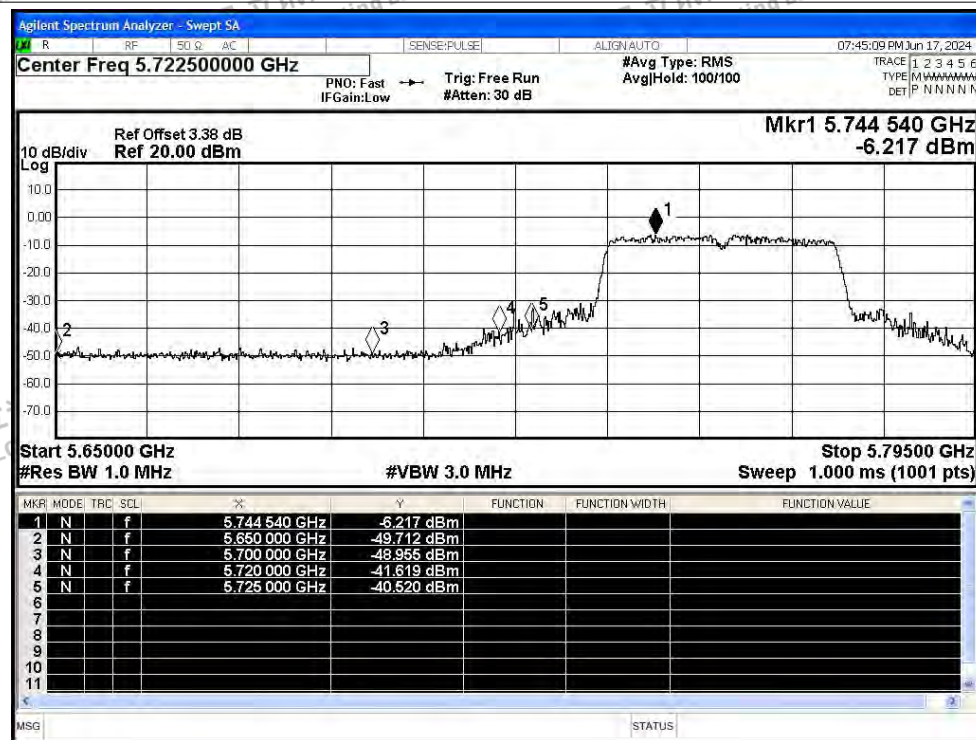

Restrict Band NVNT n40 5755MHz Ant4 Average

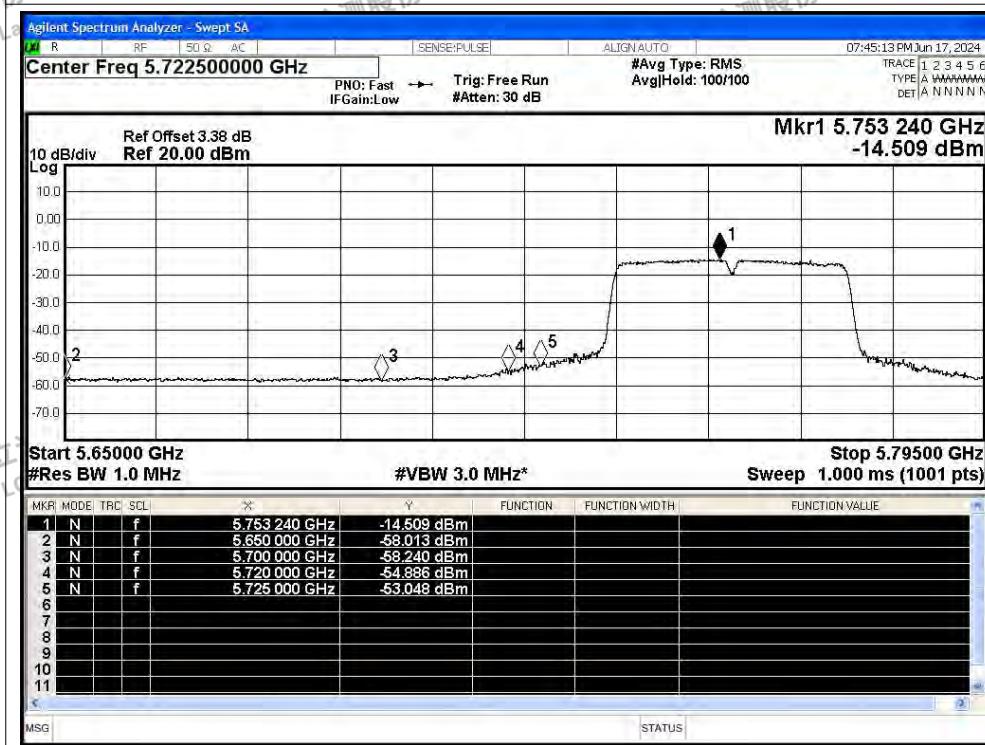

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5795MHz Ant4 Peak

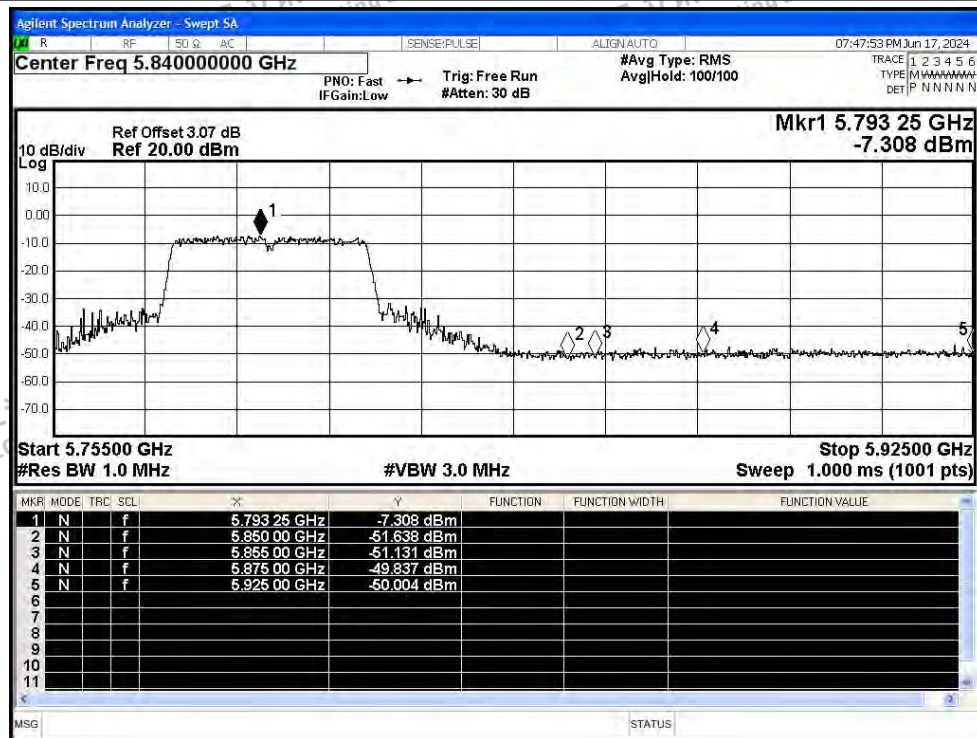

Restrict Band NVNT n40 5795MHz Ant4 Average

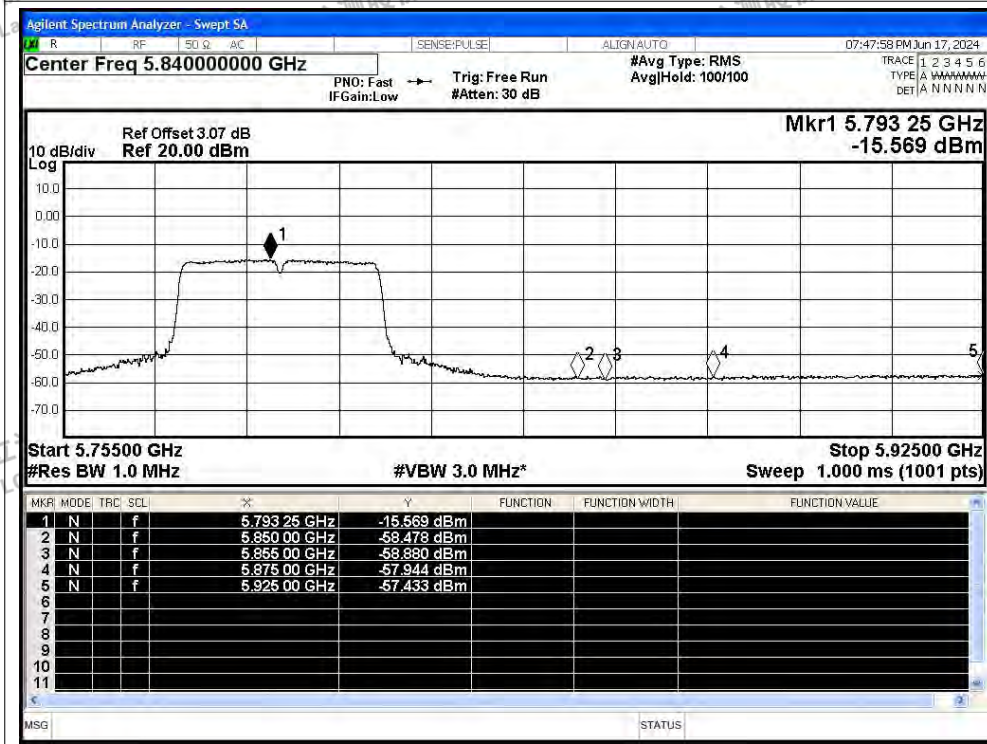

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5745MHz Ant4 Peak

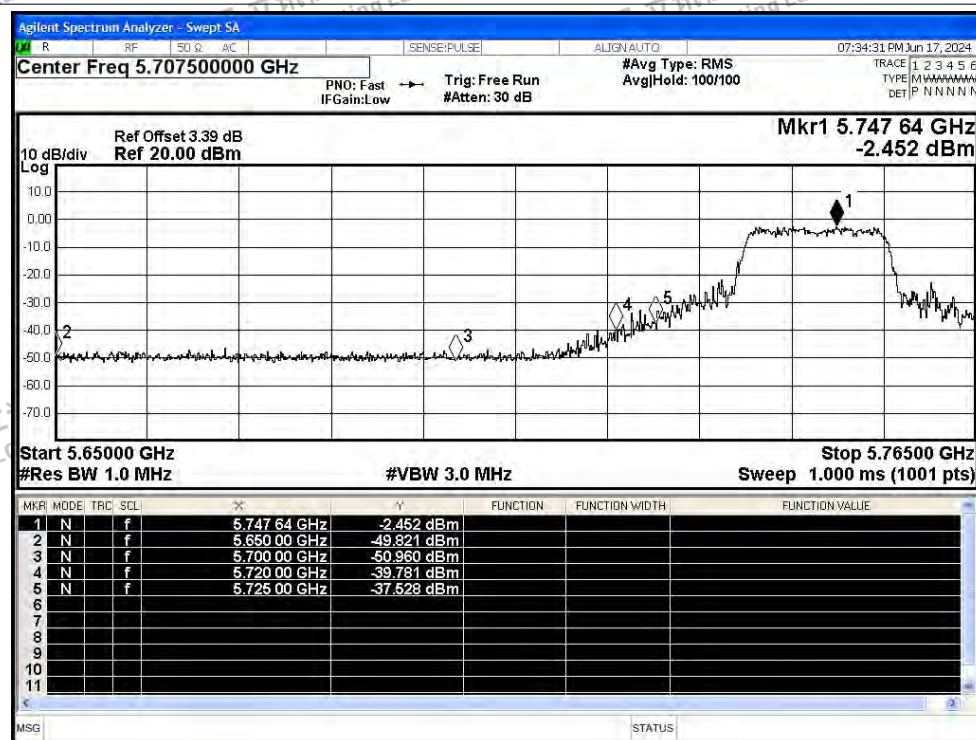

Restrict Band NVNT ac20 5745MHz Ant4 Average

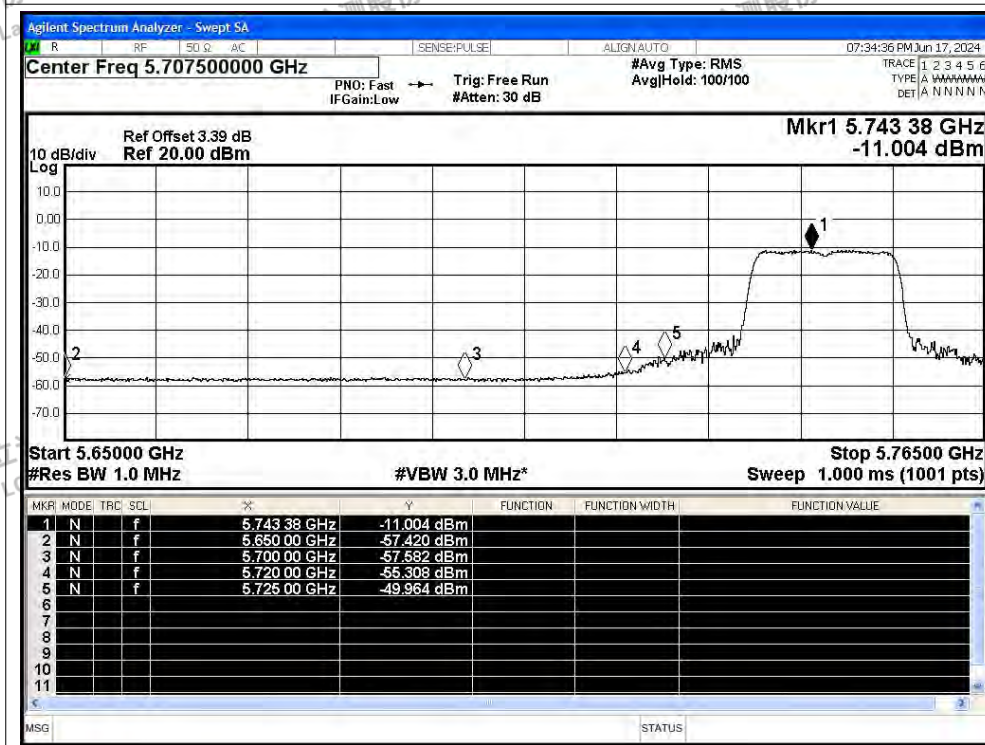

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5825MHz Ant4 Peak

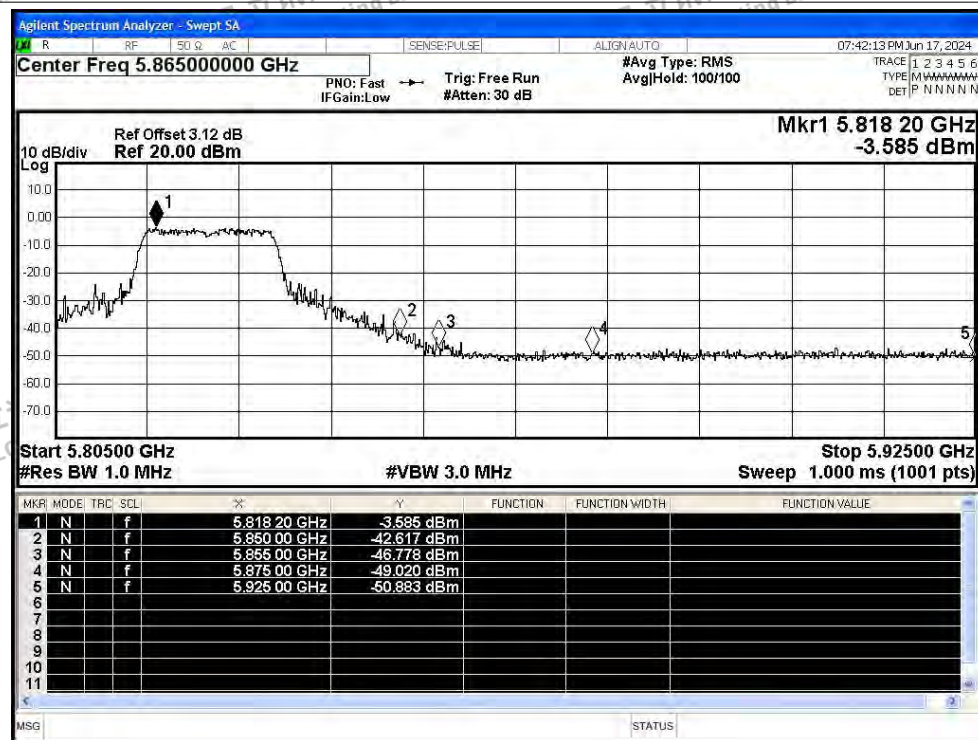

Restrict Band NVNT ac20 5825MHz Ant4 Average

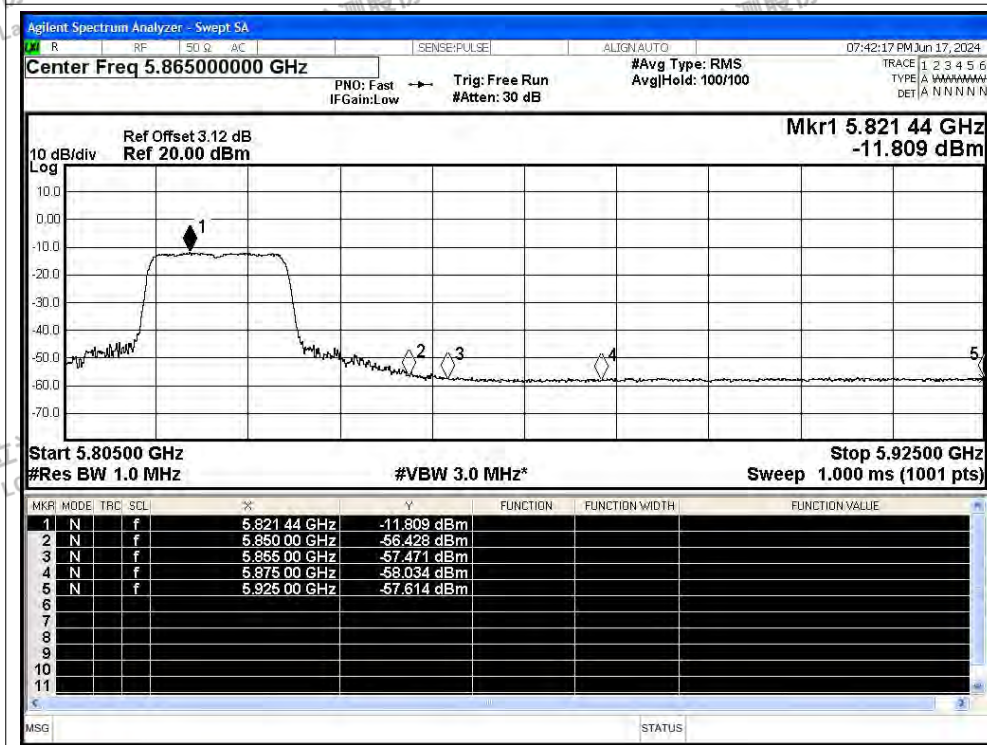

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5755MHz Ant4 Peak

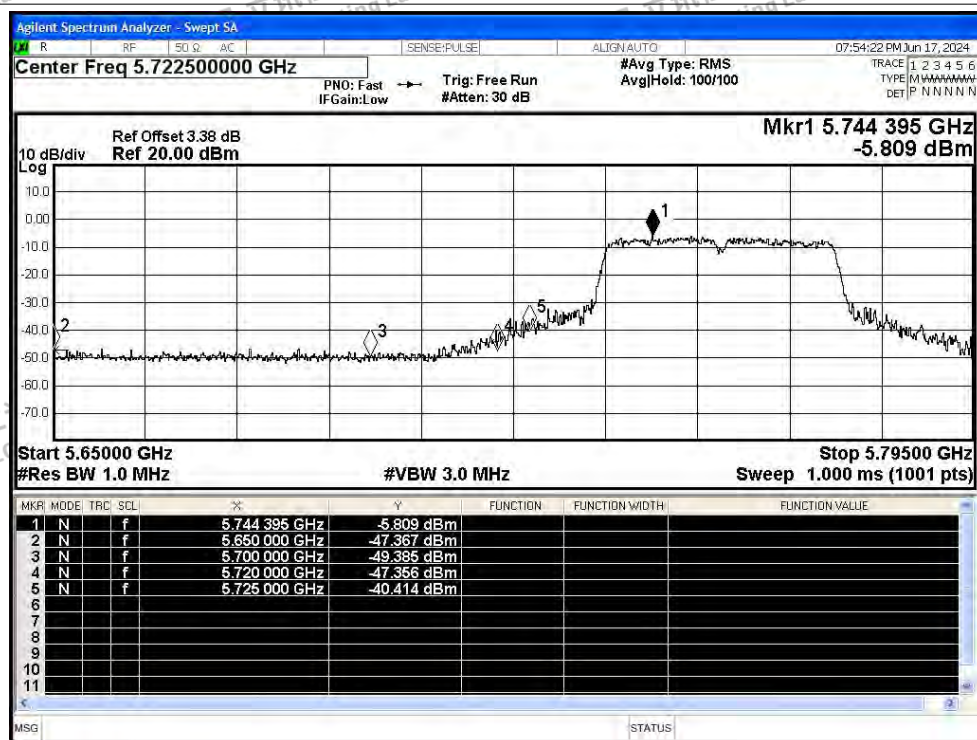

Restrict Band NVNT ac40 5755MHz Ant4 Average

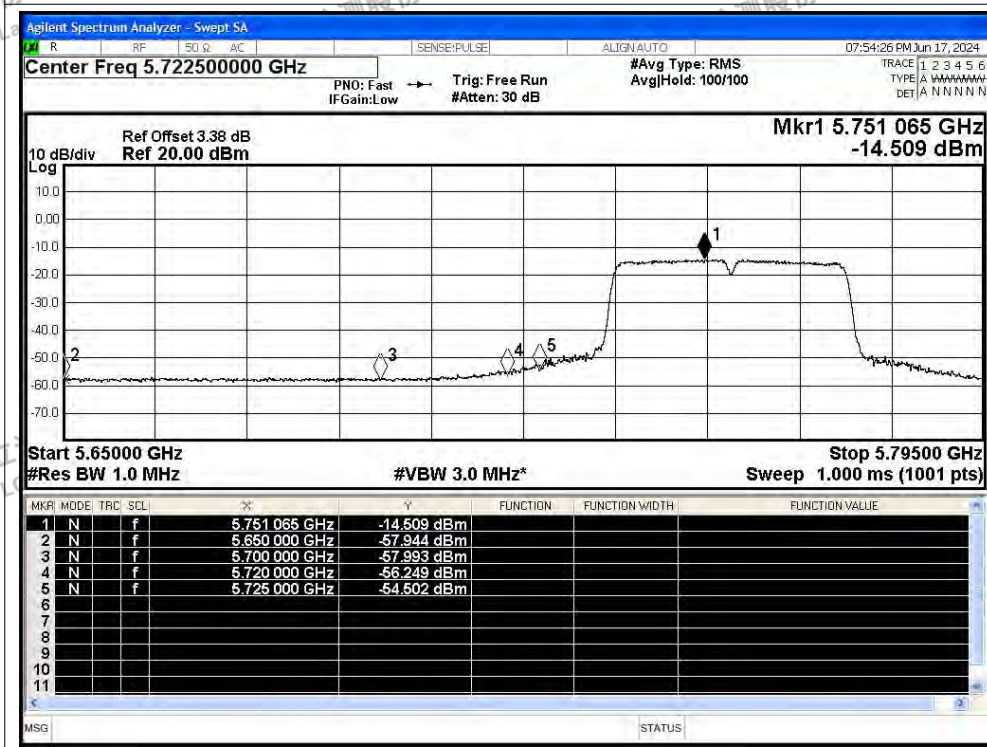

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5795MHz Ant4 Peak

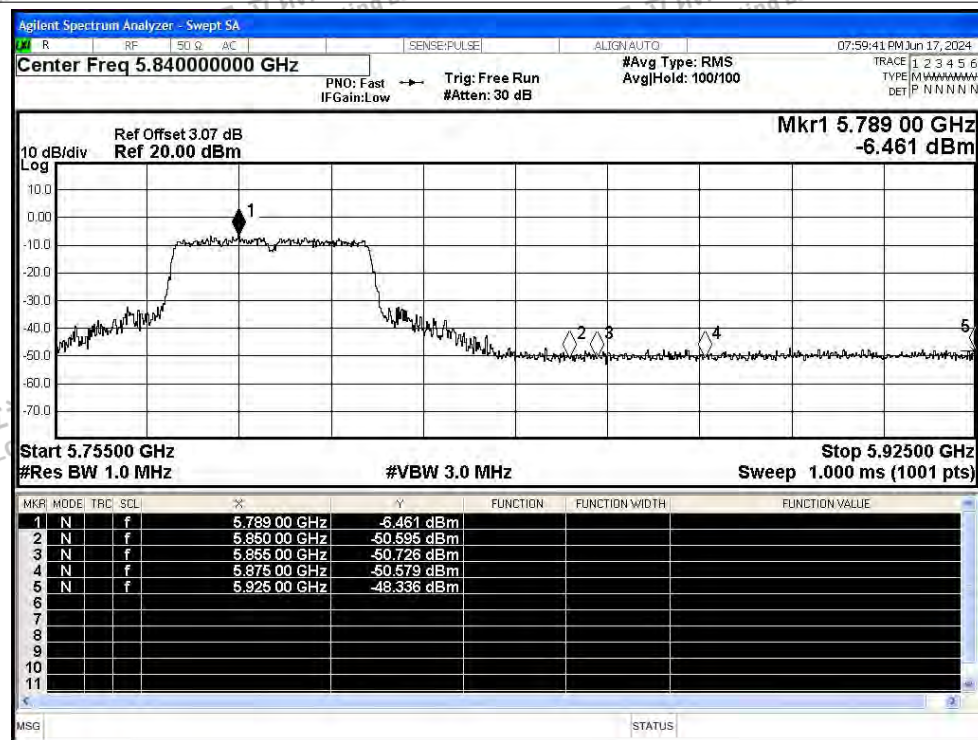

Restrict Band NVNT ac40 5795MHz Ant4 Average

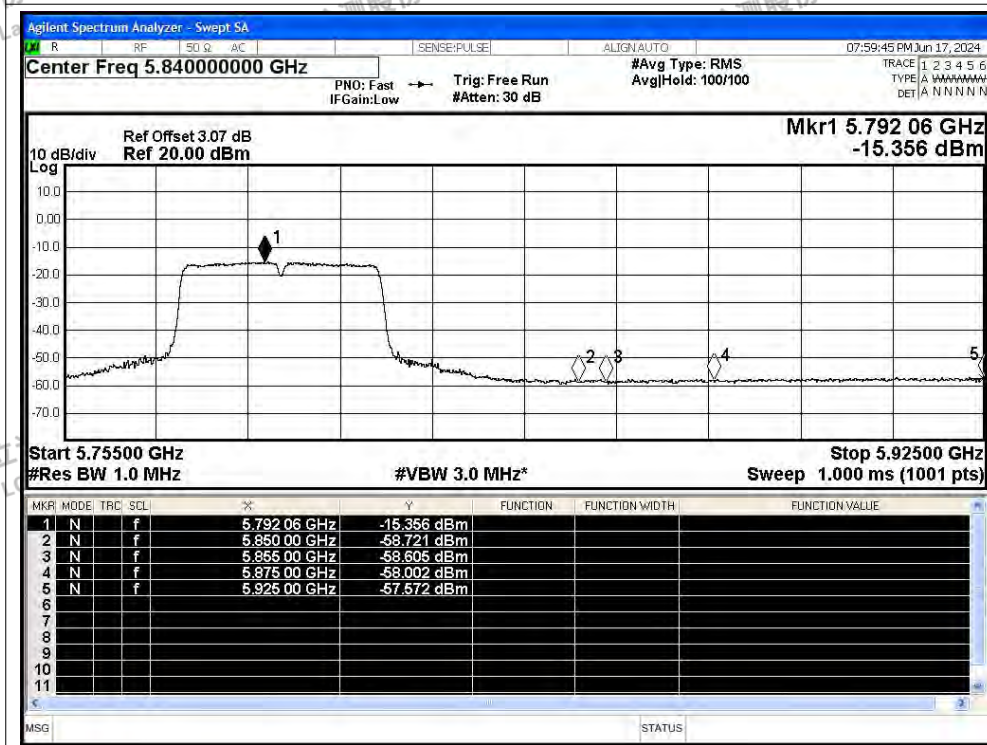

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant4 Peak

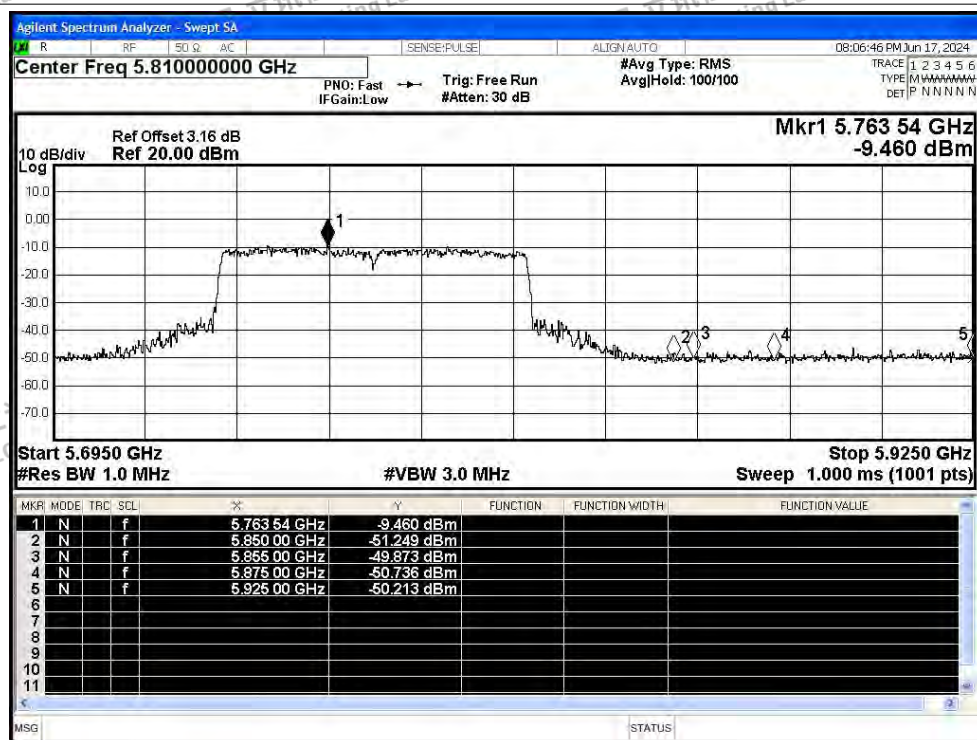

Restrict Band NVNT ac80 5775MHz Ant4 Average

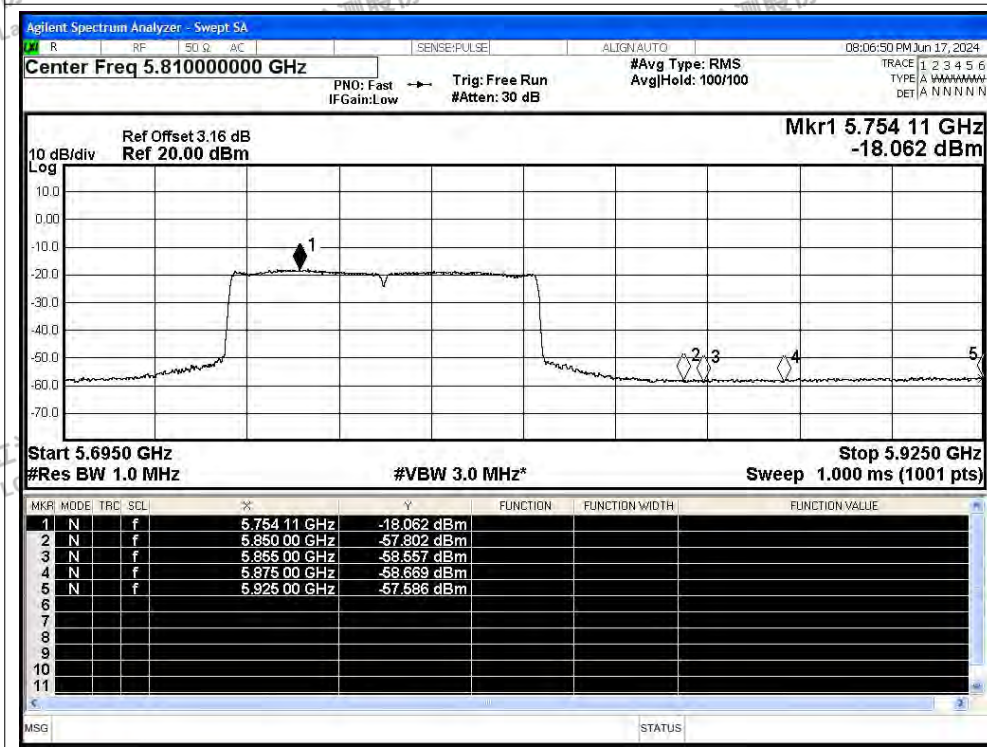

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5775MHz Ant4 Peak

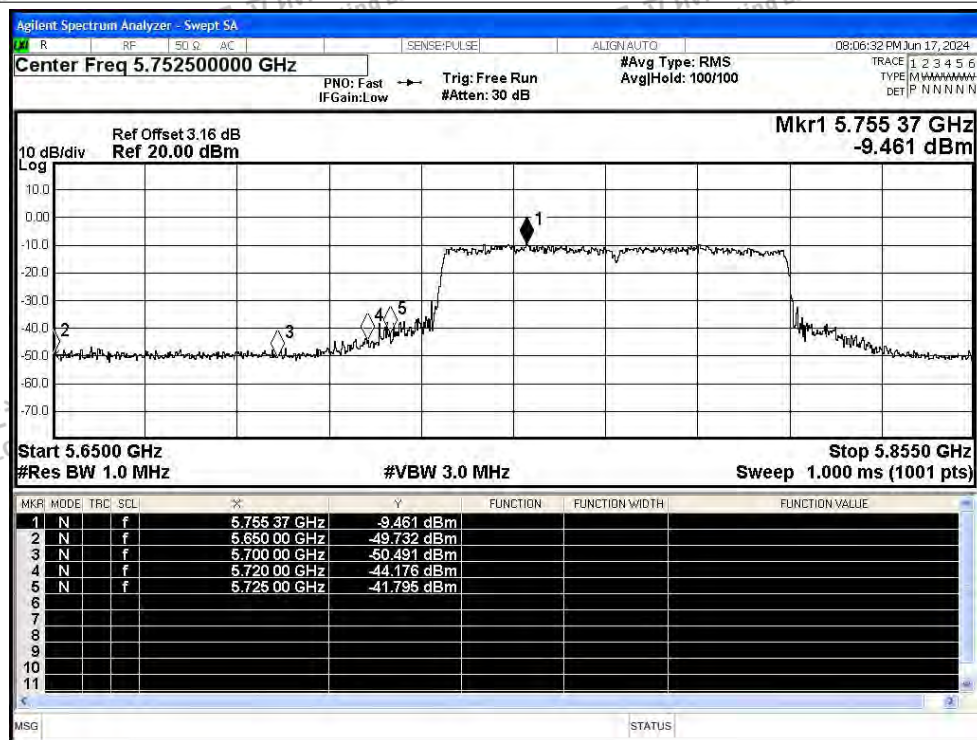

Restrict Band NVNT ac80 5775MHz Ant4 Average

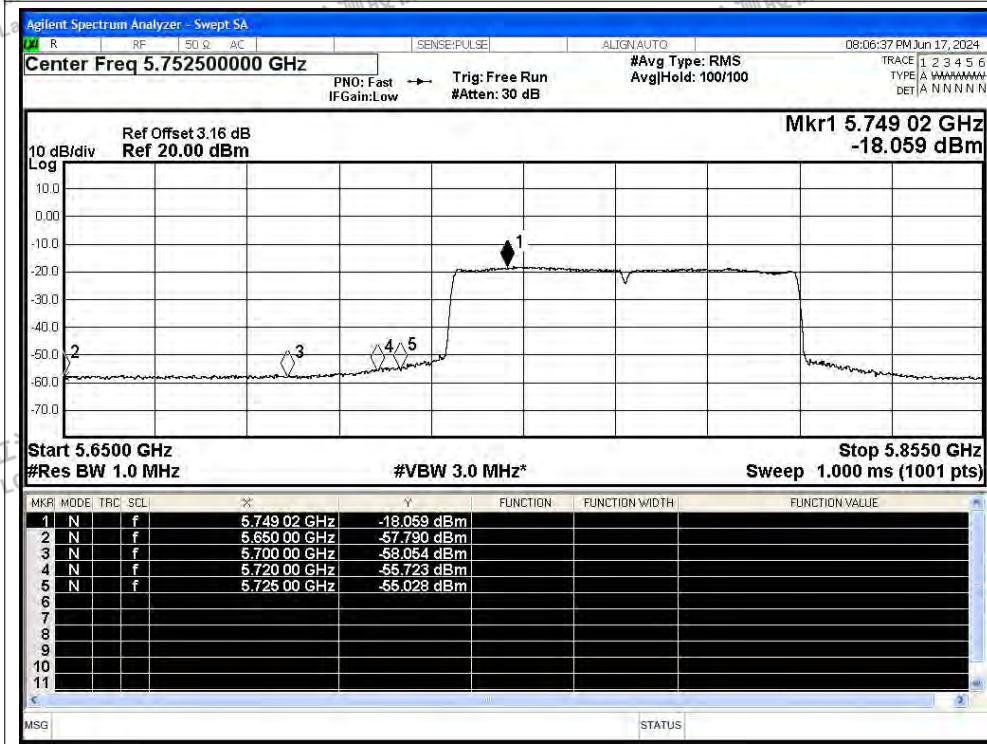

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5745MHz Ant4 Peak

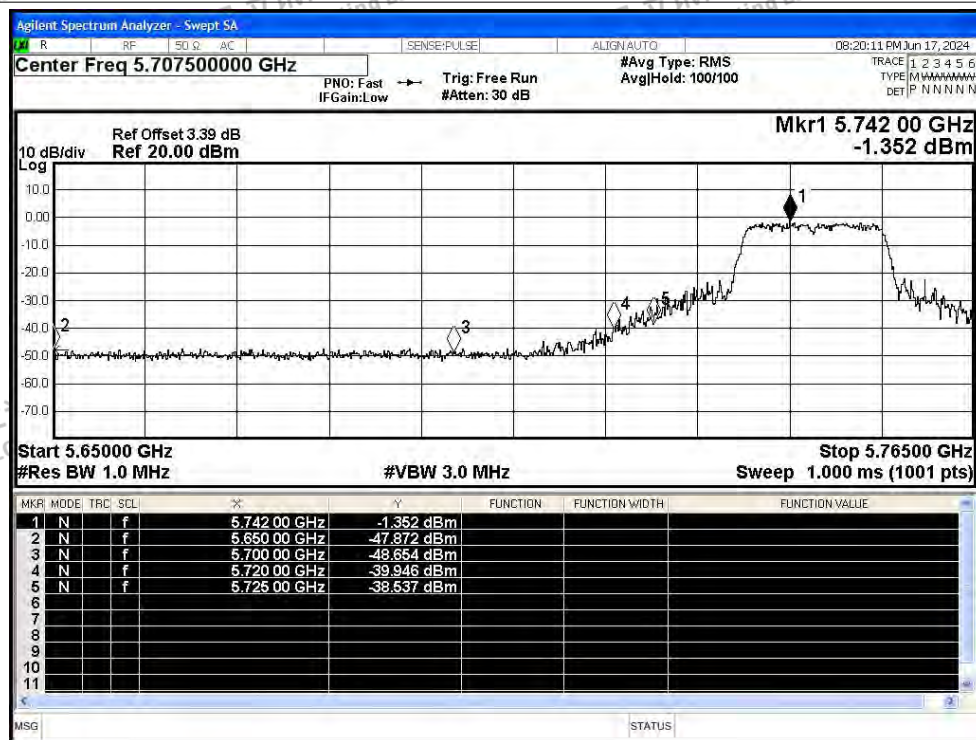

Restrict Band NVNT ax20 5745MHz Ant4 Average

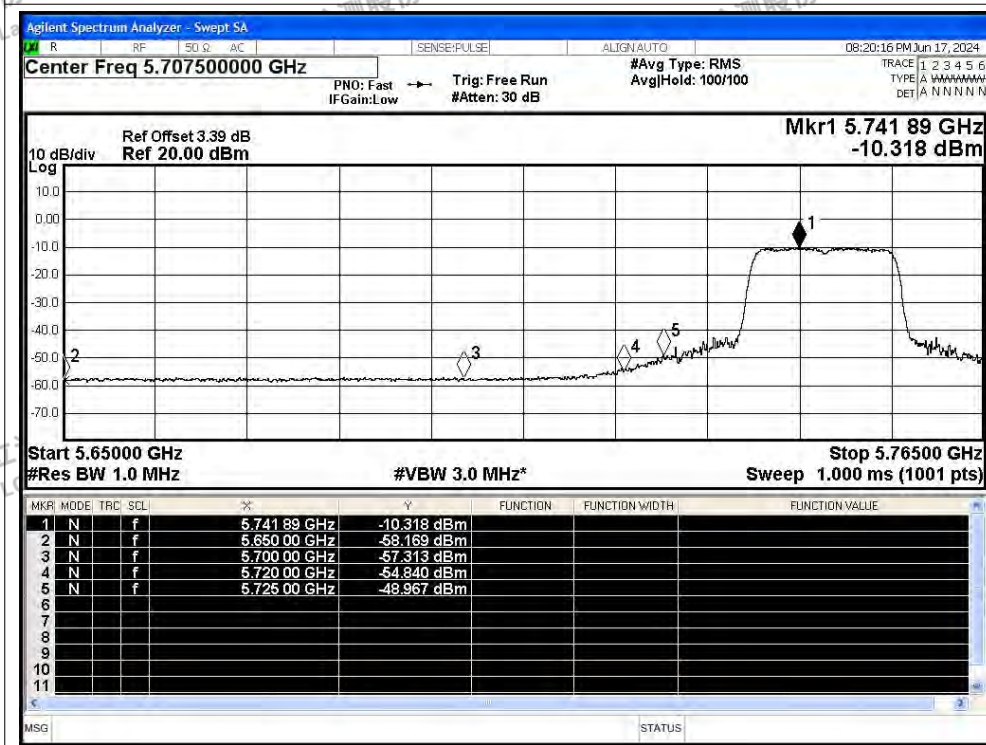

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5825MHz Ant4 Peak

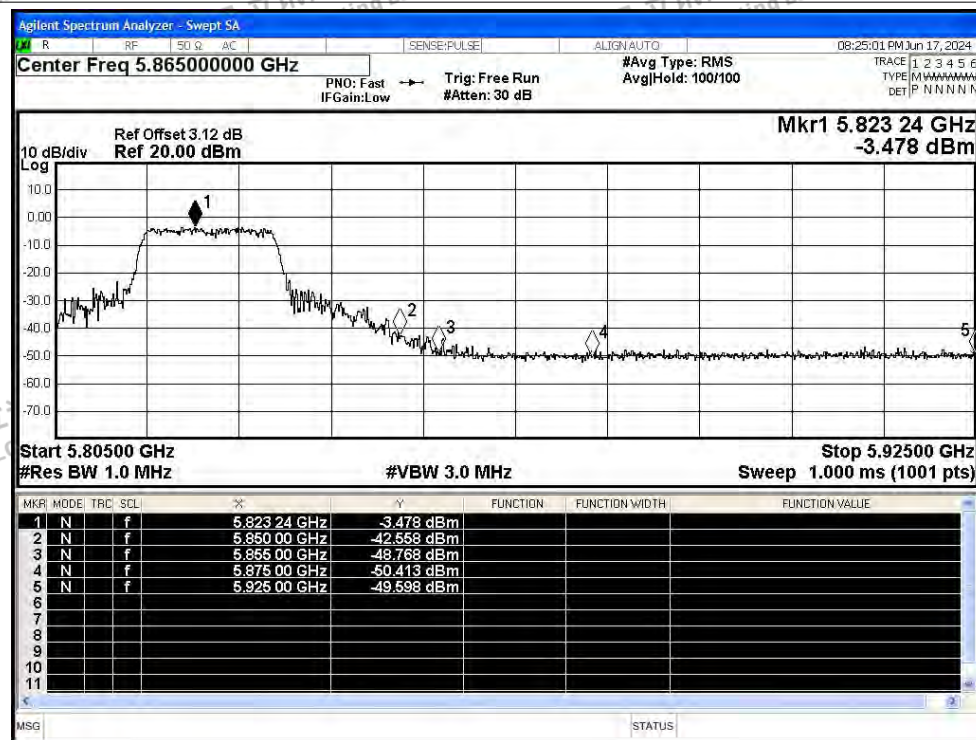

Restrict Band NVNT ax20 5825MHz Ant4 Average

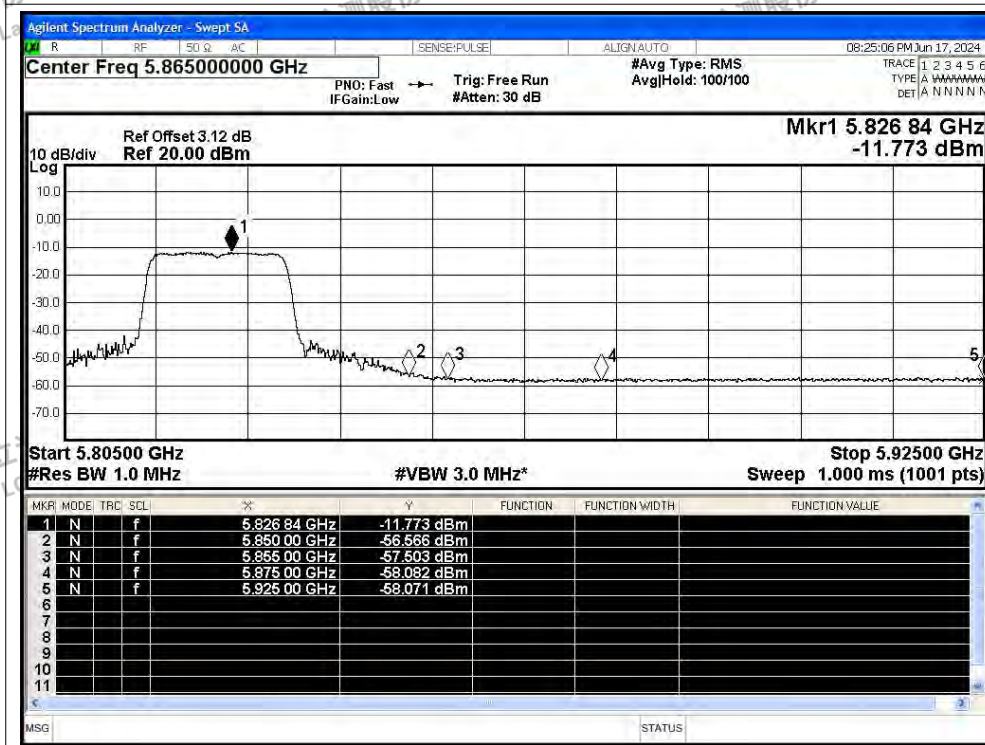

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5755MHz Ant4 Peak

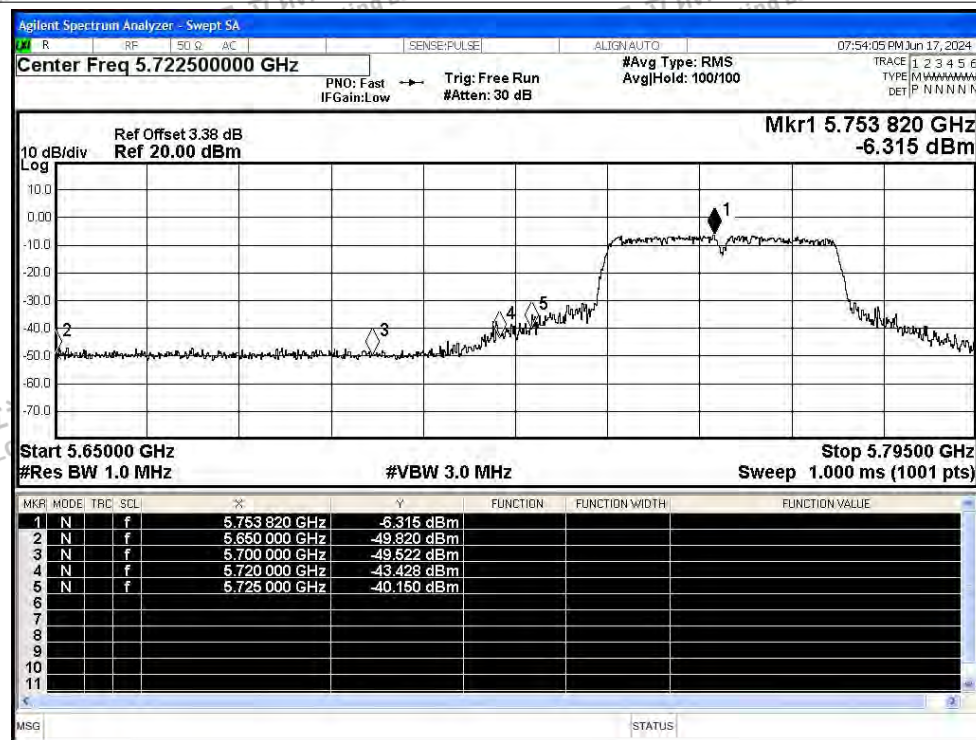

Restrict Band NVNT ax40 5755MHz Ant4 Average

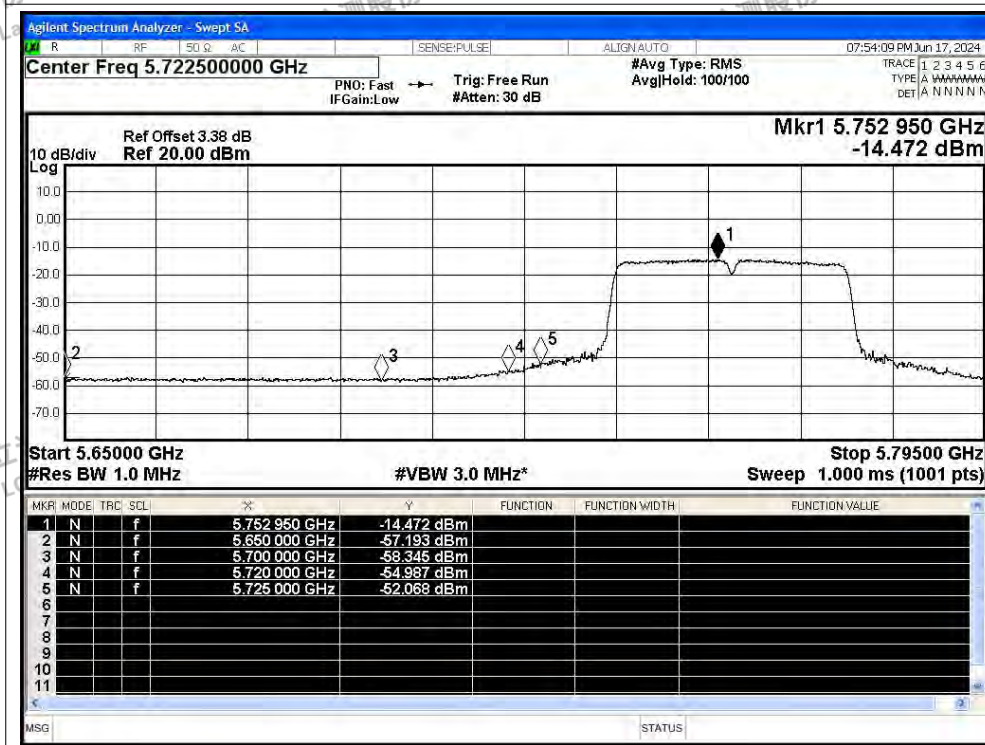

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5795MHz Ant4 Peak

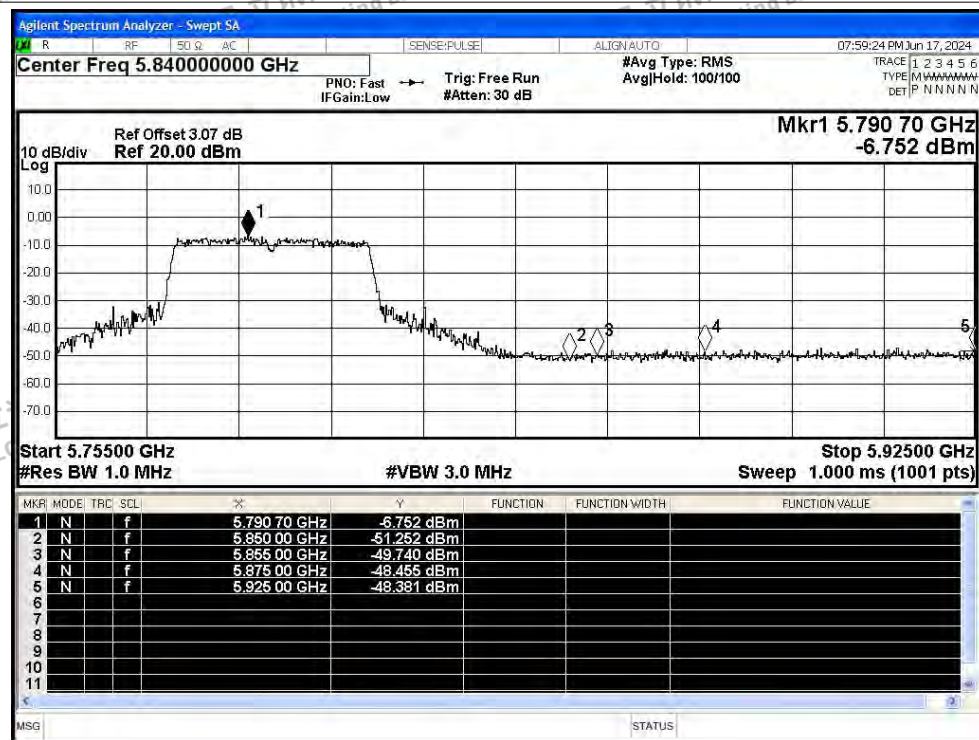

Restrict Band NVNT ax40 5795MHz Ant4 Average

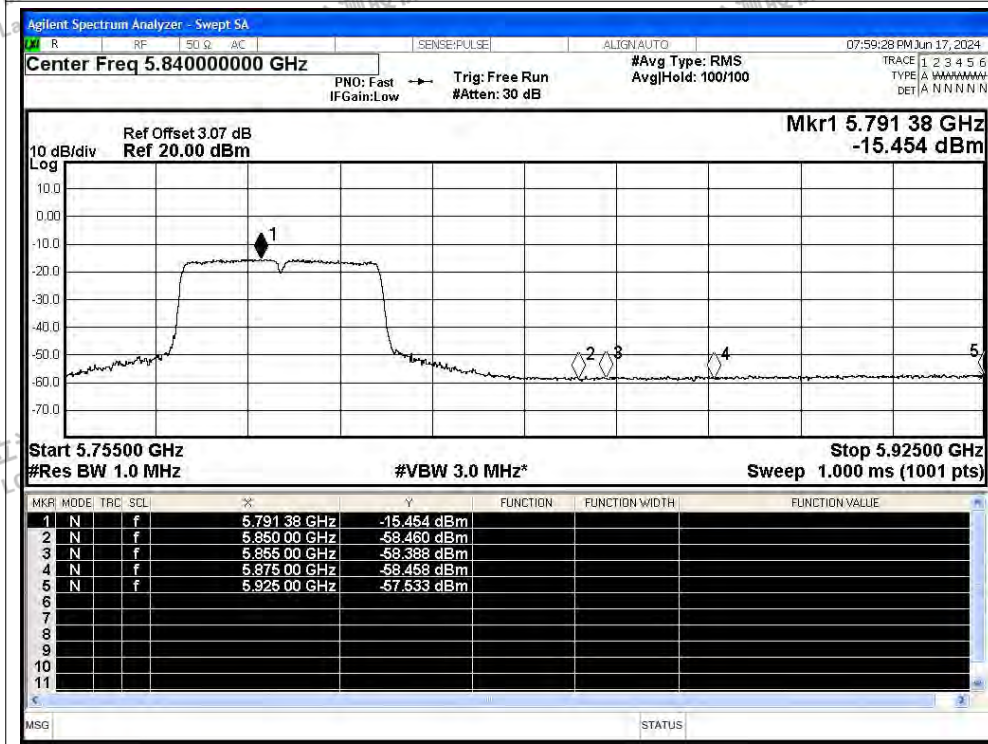

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant4 Peak

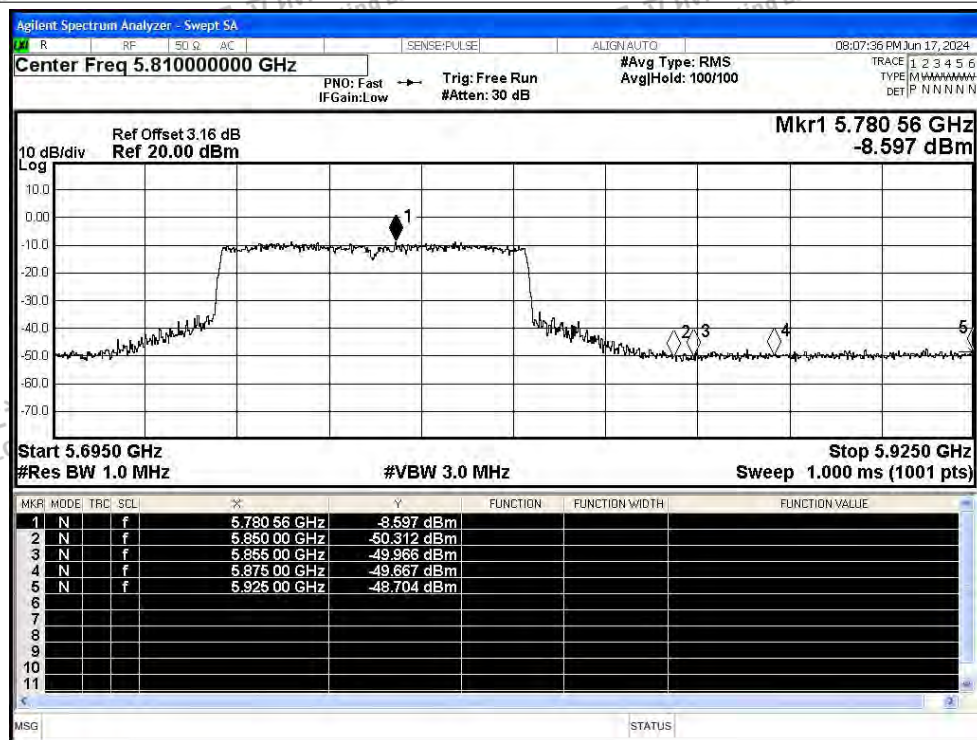

Restrict Band NVNT ax80 5775MHz Ant4 Average

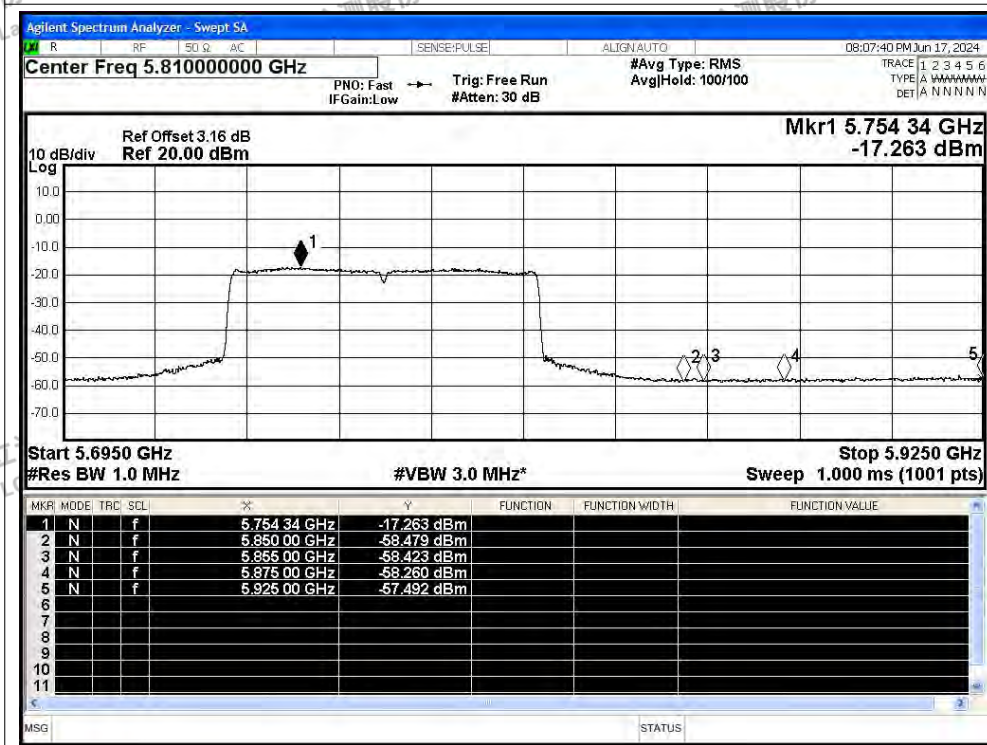

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5775MHz Ant4 Peak

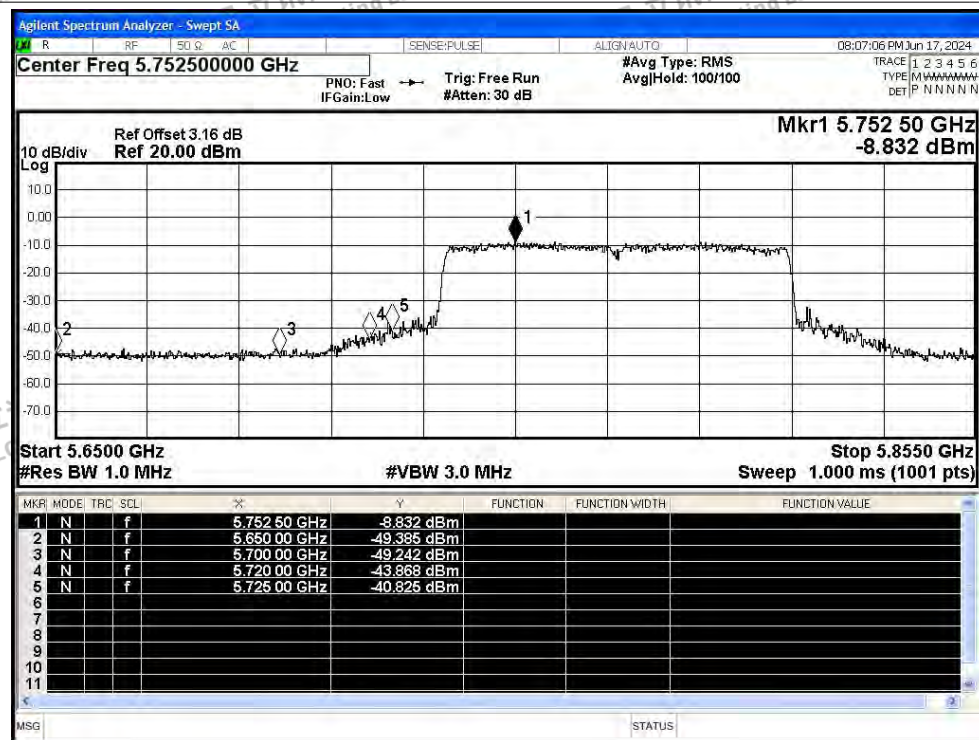

Restrict Band NVNT ax80 5775MHz Ant4 Average

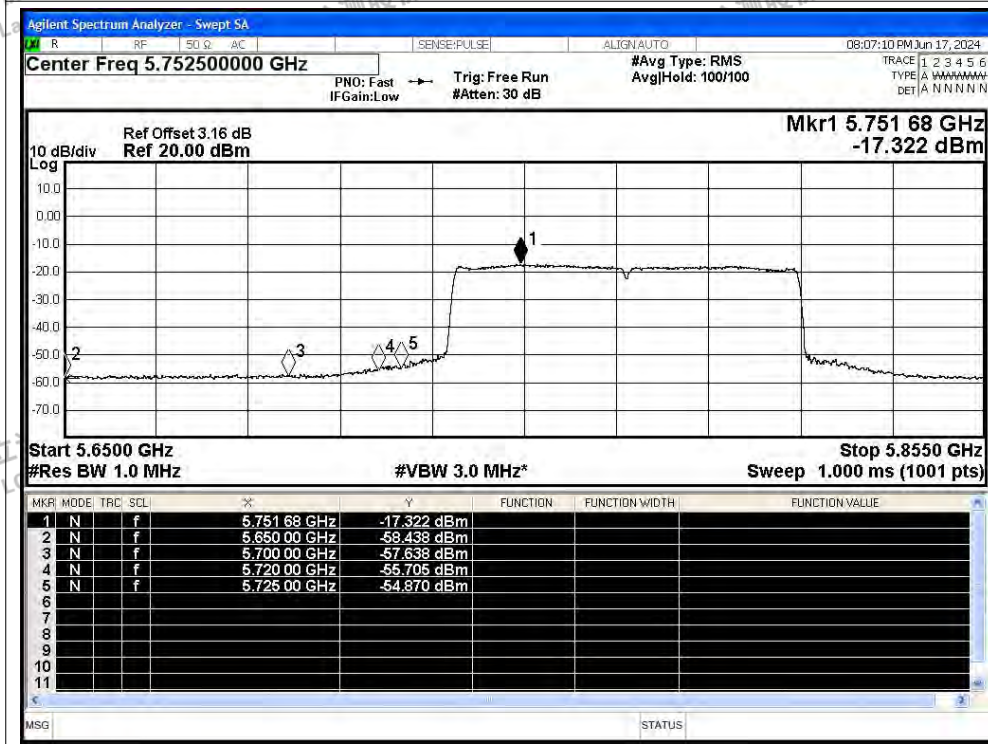

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Ant2+Ant3+Ant4:

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant2 Power (dBm)	Ant3 Power (dBm)	Ant4 Power (dBm)	Ant2+Ant3+Ant4	Gain (dBi)	EIRP Power (dBm)	Detector	Limit (dBm)	Verdict
NVNT	n20	5745	5650	-50.19	-50.38	-50.28	-45.51	8.36	-37.15	Peak	-27	Pass
NVNT	n20	5745	5650	-57.77	-57.35	-57.85	-52.88	8.36	-44.52	Average	-27	Pass
NVNT	n20	5745	5700	-50.42	-49.35	-49.19	-44.85	8.36	-36.49	Peak	10	Pass
NVNT	n20	5745	5700	-57.68	-56.67	-57.09	-52.36	8.36	-44.00	Average	10	Pass
NVNT	n20	5745	5720	-41.35	-35.08	-41.04	-33.35	8.36	-24.99	Peak	15.6	Pass
NVNT	n20	5745	5720	-54.11	-50.75	-55.54	-48.21	8.36	-39.85	Average	15.6	Pass
NVNT	n20	5745	5725	-34.81	-26.91	-30.61	-24.90	8.36	-16.54	Peak	27	Pass
NVNT	n20	5745	5725	-49.92	-44.98	-51.11	-43.04	8.36	-34.68	Average	27	Pass
NVNT	n20	5825	5850	-43.78	-40.23	-42.33	-37.10	8.36	-28.74	Peak	27	Pass
NVNT	n20	5825	5850	-55.18	-51.09	-56.17	-48.78	8.36	-40.42	Average	27	Pass
NVNT	n20	5825	5855	-47.58	-43.91	-46.88	-41.04	8.36	-32.68	Peak	15.6	Pass
NVNT	n20	5825	5855	-56.72	-54.71	-57.01	-51.25	8.36	-42.89	Average	15.6	Pass
NVNT	n20	5825	5875	-51.38	-49.16	-49.42	-45.11	8.36	-36.75	Peak	10	Pass
NVNT	n20	5825	5875	-58.18	-57.79	-58.27	-53.30	8.36	-44.94	Average	10	Pass
NVNT	n20	5825	5925	-50.58	-48.54	-47.45	-43.90	8.36	-35.54	Peak	-27	Pass
NVNT	n20	5825	5925	-57.3	-57.41	-57.57	-52.65	8.36	-44.29	Average	-27	Pass
NVNT	n40	5755	5650	-50.57	-49.3	-49.71	-45.06	8.36	-36.70	Peak	-27	Pass
NVNT	n40	5755	5650	-58.12	-57.57	-58.01	-53.12	8.36	-44.76	Average	-27	Pass
NVNT	n40	5755	5700	-50.49	-50.21	-48.96	-45.06	8.36	-36.70	Peak	10	Pass
NVNT	n40	5755	5700	-57.32	-58.14	-58.24	-53.11	8.36	-44.75	Average	10	Pass
NVNT	n40	5755	5720	-38.56	-44.05	-41.62	-36.06	8.36	-27.70	Peak	15.6	Pass
NVNT	n40	5755	5720	-52.48	-54.89	-54.89	-49.16	8.36	-40.80	Average	15.6	Pass
NVNT	n40	5755	5725	-32.44	-38.78	-40.52	-31.02	8.36	-22.66	Peak	27	Pass
NVNT	n40	5755	5725	-49.3	-54.51	-53.05	-46.94	8.36	-38.58	Average	27	Pass
NVNT	n40	5795	5850	-49.35	-49.36	-51.64	-45.22	8.36	-36.86	Peak	27	Pass
NVNT	n40	5795	5850	-58.57	-58.09	-58.48	-53.60	8.36	-45.24	Average	27	Pass
NVNT	n40	5795	5855	-49.22	-50.5	-51.13	-45.44	8.36	-37.08	Peak	15.6	Pass
NVNT	n40	5795	5855	-58.5	-58.26	-58.88	-53.77	8.36	-45.41	Average	15.6	Pass
NVNT	n40	5795	5875	-48.93	-51.61	-49.84	-45.22	8.36	-36.86	Peak	10	Pass
NVNT	n40	5795	5875	-57.95	-58.48	-57.94	-53.34	8.36	-44.98	Average	10	Pass
NVNT	n40	5795	5925	-47.99	-49.35	-50	-44.26	8.36	-35.90	Peak	-27	Pass
NVNT	n40	5795	5925	-57.55	-57.73	-57.43	-52.80	8.36	-44.44	Average	-27	Pass
NVNT	ac20	5745	5650	-50.29	-48.33	-49.82	-44.63	8.36	-36.27	Peak	-27	Pass
NVNT	ac20	5745	5650	-58.03	-57.73	-57.42	-52.95	8.36	-44.59	Average	-27	Pass
NVNT	ac20	5745	5700	-49.54	-49.54	-50.96	-45.19	8.36	-36.83	Peak	10	Pass
NVNT	ac20	5745	5700	-57.32	-57.35	-57.58	-52.64	8.36	-44.28	Average	10	Pass
NVNT	ac20	5745	5720	-42.26	-39.65	-39.78	-35.64	8.36	-27.28	Peak	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5745	5720	-54.15	-55.39	-55.31	-50.14	8.36	-41.78	Average	15.6	Pass
NVNT	ac20	5745	5725	-35.5	-34.17	-37.53	-30.75	8.36	-22.39	Peak	27	Pass
NVNT	ac20	5745	5725	-47.93	-51.36	-49.96	-44.75	8.36	-36.39	Average	27	Pass
NVNT	ac20	5825	5850	-43.94	-28.65	-42.62	-28.36	8.36	-20.00	Peak	27	Pass
NVNT	ac20	5825	5850	-54.75	-42.41	-56.43	-42.00	8.36	-33.64	Average	27	Pass
NVNT	ac20	5825	5855	-46.26	-35.39	-46.78	-34.77	8.36	-26.41	Peak	15.6	Pass
NVNT	ac20	5825	5855	-57.03	-46.96	-57.47	-46.21	8.36	-37.85	Average	15.6	Pass
NVNT	ac20	5825	5875	-48.87	-46.34	-49.02	-43.12	8.36	-34.76	Peak	10	Pass
NVNT	ac20	5825	5875	-57.97	-55.29	-58.03	-52.13	8.36	-43.77	Average	10	Pass
NVNT	ac20	5825	5925	-49.11	-47.4	-50.88	-44.13	8.36	-35.77	Peak	-27	Pass
NVNT	ac20	5825	5925	-57.73	-56.55	-57.61	-52.49	8.36	-44.13	Average	-27	Pass
NVNT	ac40	5755	5650	-50.33	-49.74	-47.37	-44.18	8.36	-35.82	Peak	-27	Pass
NVNT	ac40	5755	5650	-57.86	-57.51	-57.94	-52.99	8.36	-44.63	Average	-27	Pass
NVNT	ac40	5755	5700	-50.18	-49.89	-49.39	-45.04	8.36	-36.68	Peak	10	Pass
NVNT	ac40	5755	5700	-57.62	-57.21	-57.99	-52.82	8.36	-44.46	Average	10	Pass
NVNT	ac40	5755	5720	-42.4	-43.4	-47.36	-39.15	8.36	-30.79	Peak	15.6	Pass
NVNT	ac40	5755	5720	-52.77	-54.19	-56.25	-49.41	8.36	-41.05	Average	15.6	Pass
NVNT	ac40	5755	5725	-36.67	-38.81	-40.41	-33.59	8.36	-25.23	Peak	27	Pass
NVNT	ac40	5755	5725	-49.91	-52.33	-54.5	-47.08	8.36	-38.72	Average	27	Pass
NVNT	ac40	5795	5850	-50.82	-50.06	-50.6	-45.71	8.36	-37.35	Peak	27	Pass
NVNT	ac40	5795	5850	-58.33	-58.47	-58.72	-53.73	8.36	-45.37	Average	27	Pass
NVNT	ac40	5795	5855	-51.16	-49.76	-50.73	-45.74	8.36	-37.38	Peak	15.6	Pass
NVNT	ac40	5795	5855	-58.35	-58.27	-58.61	-53.64	8.36	-45.28	Average	15.6	Pass
NVNT	ac40	5795	5875	-50.22	-49.61	-50.58	-45.35	8.36	-36.99	Peak	10	Pass
NVNT	ac40	5795	5875	-58.18	-58.25	-58	-53.37	8.36	-45.01	Average	10	Pass
NVNT	ac40	5795	5925	-50.84	-50.42	-48.34	-44.95	8.36	-36.59	Peak	-27	Pass
NVNT	ac40	5795	5925	-57.82	-57.72	-57.57	-52.93	8.36	-44.57	Average	-27	Pass
NVNT	ac80	5775	5850	-49.19	-50.33	-51.25	-45.40	8.36	-37.04	Peak	27	Pass
NVNT	ac80	5775	5850	-57.46	-57.95	-57.8	-52.96	8.36	-44.60	Average	27	Pass
NVNT	ac80	5775	5855	-47.28	-51.32	-49.87	-44.39	8.36	-36.03	Peak	15.6	Pass
NVNT	ac80	5775	5855	-57.41	-58.16	-58.56	-53.25	8.36	-44.89	Average	15.6	Pass
NVNT	ac80	5775	5875	-49.74	-50.03	-50.74	-45.38	8.36	-37.02	Peak	10	Pass
NVNT	ac80	5775	5875	-57.14	-58.21	-58.67	-53.19	8.36	-44.83	Average	10	Pass
NVNT	ac80	5775	5925	-49.85	-51.02	-50.21	-45.56	8.36	-37.20	Peak	-27	Pass
NVNT	ac80	5775	5925	-57.24	-57.65	-57.59	-52.72	8.36	-44.36	Average	-27	Pass
NVNT	ac80	5775	5650	-51.43	-49.54	-49.73	-45.38	8.36	-37.02	Peak	-27	Pass
NVNT	ac80	5775	5650	-57.63	-57.61	-57.79	-52.90	8.36	-44.54	Average	-27	Pass
NVNT	ac80	5775	5700	-49.45	-50.66	-50.49	-45.40	8.36	-37.04	Peak	10	Pass
NVNT	ac80	5775	5700	-57.29	-58.61	-58.05	-53.18	8.36	-44.82	Average	10	Pass
NVNT	ac80	5775	5720	-40.33	-46.77	-44.18	-38.18	8.36	-29.82	Peak	15.6	Pass
NVNT	ac80	5775	5720	-53.48	-55.27	-55.72	-49.94	8.36	-41.58	Average	15.6	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac80	5775	5725	-36.08	-39.35	-41.8	-33.68	8.36	-25.32	Peak	27	Pass
NVNT	ac80	5775	5725	-51.55	-53.62	-55.03	-48.39	8.36	-40.03	Average	27	Pass
NVNT	ax20	5745	5650	-50.04	-48.2	-47.87	-43.83	8.36	-35.47	Peak	-27	Pass
NVNT	ax20	5745	5650	-57.57	-57.5	-58.17	-52.97	8.36	-44.61	Average	-27	Pass
NVNT	ax20	5745	5700	-49.12	-47.98	-48.65	-43.79	8.36	-35.43	Peak	10	Pass
NVNT	ax20	5745	5700	-58.34	-57.82	-57.31	-53.03	8.36	-44.67	Average	10	Pass
NVNT	ax20	5745	5720	-42.52	-43.97	-39.95	-37.05	8.36	-28.69	Peak	15.6	Pass
NVNT	ax20	5745	5720	-53.73	-54.3	-54.84	-49.50	8.36	-41.14	Average	15.6	Pass
NVNT	ax20	5745	5725	-32.99	-35.72	-38.54	-30.41	8.36	-22.05	Peak	27	Pass
NVNT	ax20	5745	5725	-49.19	-49.62	-48.97	-44.48	8.36	-36.12	Average	27	Pass
NVNT	ax20	5825	5850	-43.11	-44.88	-42.56	-38.64	8.36	-30.28	Peak	27	Pass
NVNT	ax20	5825	5850	-55.19	-55.21	-56.57	-50.84	8.36	-42.48	Average	27	Pass
NVNT	ax20	5825	5855	-46.41	-48.25	-48.77	-42.92	8.36	-34.56	Peak	15.6	Pass
NVNT	ax20	5825	5855	-56.85	-57.6	-57.5	-52.53	8.36	-44.17	Average	15.6	Pass
NVNT	ax20	5825	5875	-51.69	-49.5	-50.41	-45.67	8.36	-37.31	Peak	10	Pass
NVNT	ax20	5825	5875	-57.93	-57.87	-58.08	-53.19	8.36	-44.83	Average	10	Pass
NVNT	ax20	5825	5925	-50.09	-48.52	-49.6	-44.58	8.36	-36.22	Peak	-27	Pass
NVNT	ax20	5825	5925	-58.23	-57.14	-58.07	-53.01	8.36	-44.65	Average	-27	Pass
NVNT	ax40	5755	5650	-48.34	-49.7	-49.82	-44.46	8.36	-36.10	Peak	-27	Pass
NVNT	ax40	5755	5650	-58.03	-58.18	-57.19	-53.01	8.36	-44.65	Average	-27	Pass
NVNT	ax40	5755	5700	-49.8	-51.04	-49.52	-45.30	8.36	-36.94	Peak	10	Pass
NVNT	ax40	5755	5700	-57.78	-58.49	-58.35	-53.42	8.36	-45.06	Average	10	Pass
NVNT	ax40	5755	5720	-37.99	-42.47	-43.43	-35.84	8.36	-27.48	Peak	15.6	Pass
NVNT	ax40	5755	5720	-52.69	-55.39	-54.99	-49.41	8.36	-41.05	Average	15.6	Pass
NVNT	ax40	5755	5725	-36.23	-35.72	-40.15	-32.20	8.36	-23.84	Peak	27	Pass
NVNT	ax40	5755	5725	-49.74	-53.51	-52.07	-46.72	8.36	-38.36	Average	27	Pass
NVNT	ax40	5795	5850	-51.72	-49.27	-51.25	-45.84	8.36	-37.48	Peak	27	Pass
NVNT	ax40	5795	5850	-58.18	-58.38	-58.46	-53.57	8.36	-45.21	Average	27	Pass
NVNT	ax40	5795	5855	-50.97	-50.97	-49.74	-45.75	8.36	-37.39	Peak	15.6	Pass
NVNT	ax40	5795	5855	-58.4	-58.71	-58.39	-53.73	8.36	-45.37	Average	15.6	Pass
NVNT	ax40	5795	5875	-49.73	-50.49	-48.46	-44.71	8.36	-36.35	Peak	10	Pass
NVNT	ax40	5795	5875	-58.57	-58.34	-58.46	-53.68	8.36	-45.32	Average	10	Pass
NVNT	ax40	5795	5925	-50.28	-49.63	-48.38	-44.59	8.36	-36.23	Peak	-27	Pass
NVNT	ax40	5795	5925	-57.91	-58.45	-57.53	-53.18	8.36	-44.82	Average	-27	Pass
NVNT	ax80	5775	5850	-50.68	-49.54	-50.31	-45.38	8.36	-37.02	Peak	27	Pass
NVNT	ax80	5775	5850	-57.37	-58.09	-58.48	-53.18	8.36	-44.82	Average	27	Pass
NVNT	ax80	5775	5855	-49.07	-51.42	-49.97	-45.28	8.36	-36.92	Peak	15.6	Pass
NVNT	ax80	5775	5855	-57.83	-58.14	-58.42	-53.35	8.36	-44.99	Average	15.6	Pass
NVNT	ax80	5775	5875	-50.03	-50.26	-49.67	-45.21	8.36	-36.85	Peak	10	Pass
NVNT	ax80	5775	5875	-58.12	-58.31	-58.26	-53.46	8.36	-45.10	Average	10	Pass
NVNT	ax80	5775	5925	-50.28	-50.78	-48.7	-45.06	8.36	-36.70	Peak	-27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax80	5775	5925	-57.43	-58.04	-57.49	-52.87	8.36	-44.51	Average	-27	Pass
NVNT	ax80	5775	5650	-49.44	-49.99	-49.39	-44.83	8.36	-36.47	Peak	-27	Pass
NVNT	ax80	5775	5650	-58.12	-58.12	-58.44	-53.45	8.36	-45.09	Average	-27	Pass
NVNT	ax80	5775	5700	-49.61	-49.46	-49.24	-44.66	8.36	-36.30	Peak	10	Pass
NVNT	ax80	5775	5700	-57.62	-57.95	-57.64	-52.96	8.36	-44.60	Average	10	Pass
NVNT	ax80	5775	5720	-43.82	-45.21	-43.87	-39.48	8.36	-31.12	Peak	15.6	Pass
NVNT	ax80	5775	5720	-52.75	-55.56	-55.71	-49.68	8.36	-41.32	Average	15.6	Pass
NVNT	ax80	5775	5725	-37.41	-43.72	-40.83	-35.13	8.36	-26.77	Peak	27	Pass
NVNT	ax80	5775	5725	-51.96	-53.38	-54.87	-48.47	8.36	-40.11	Average	27	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



G.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	n40	5755	Ant2	5755	0	0	25	Pass
NVNT	n40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac20	5745	Ant2	5745	0	0	25	Pass
NVNT	ac20	5785	Ant2	5785	0	0	25	Pass
NVNT	ac20	5825	Ant2	5825	0	0	25	Pass
NVNT	ac40	5755	Ant2	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant2	5795	0	0	25	Pass
NVNT	ac80	5775	Ant2	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT n40 5755MHz Ant2

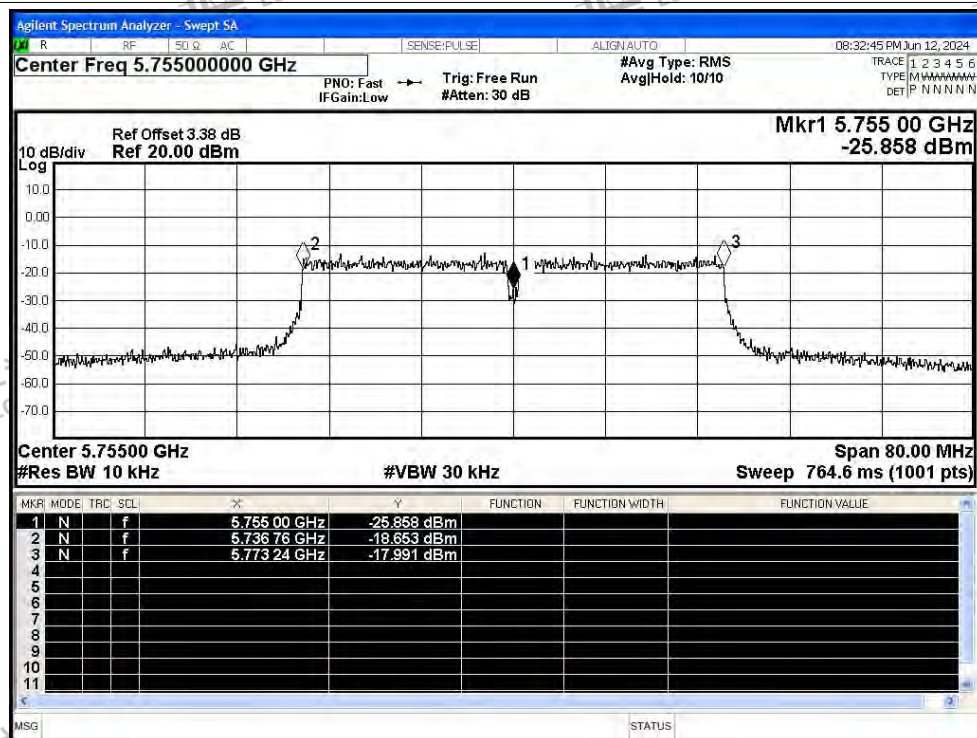

Freq. Stability NVNT n40 5795MHz Ant2

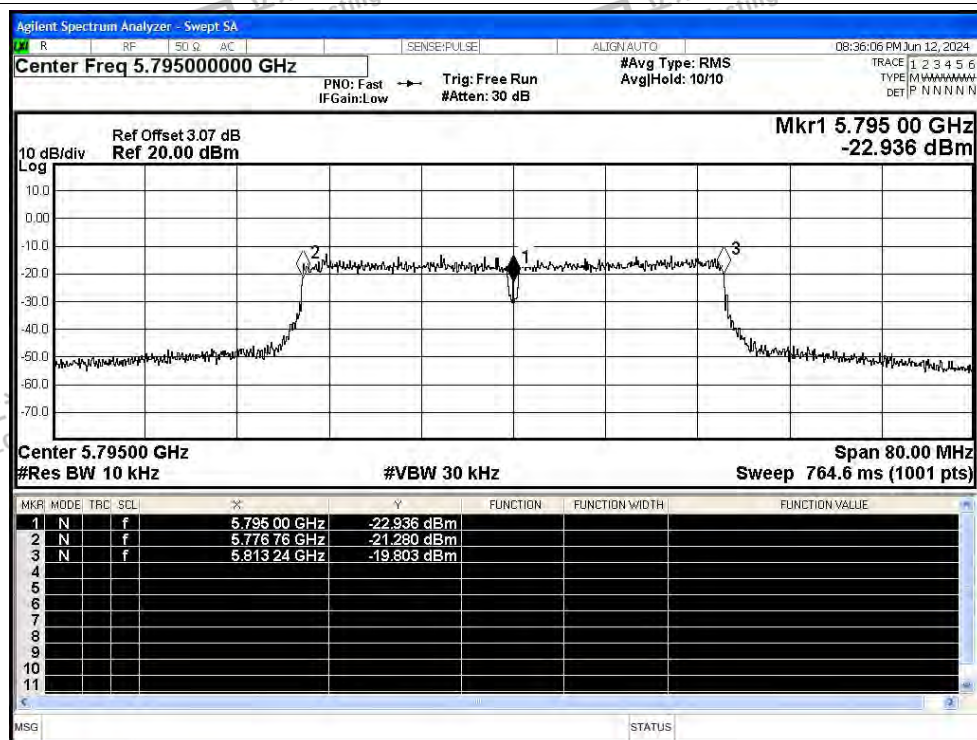

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant2

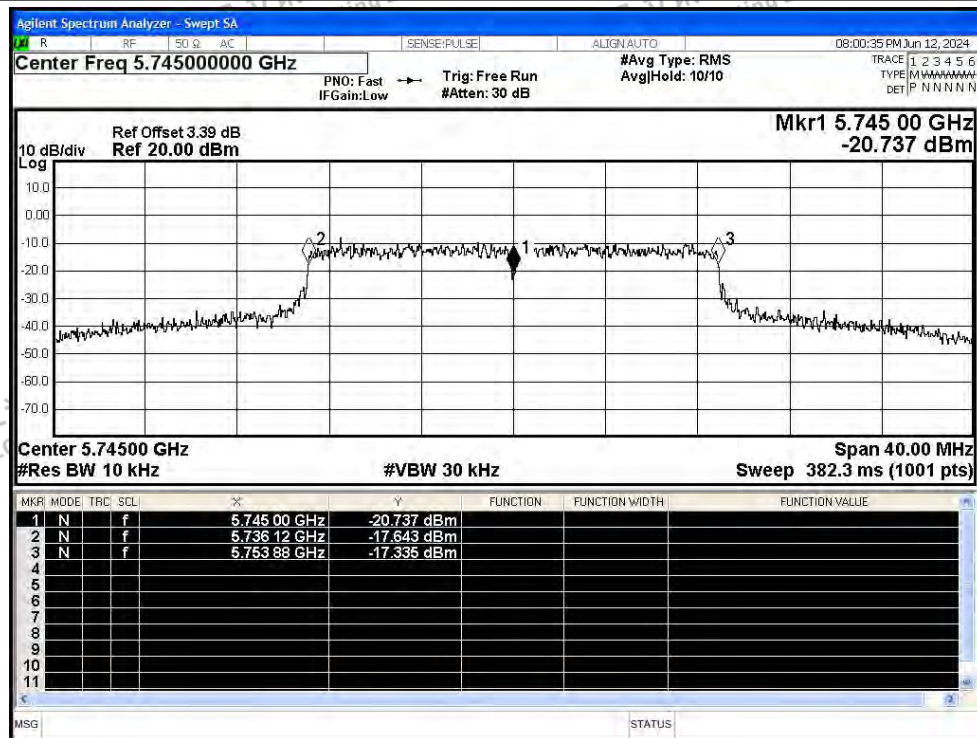

Freq. Stability NVNT ac20 5785MHz Ant2

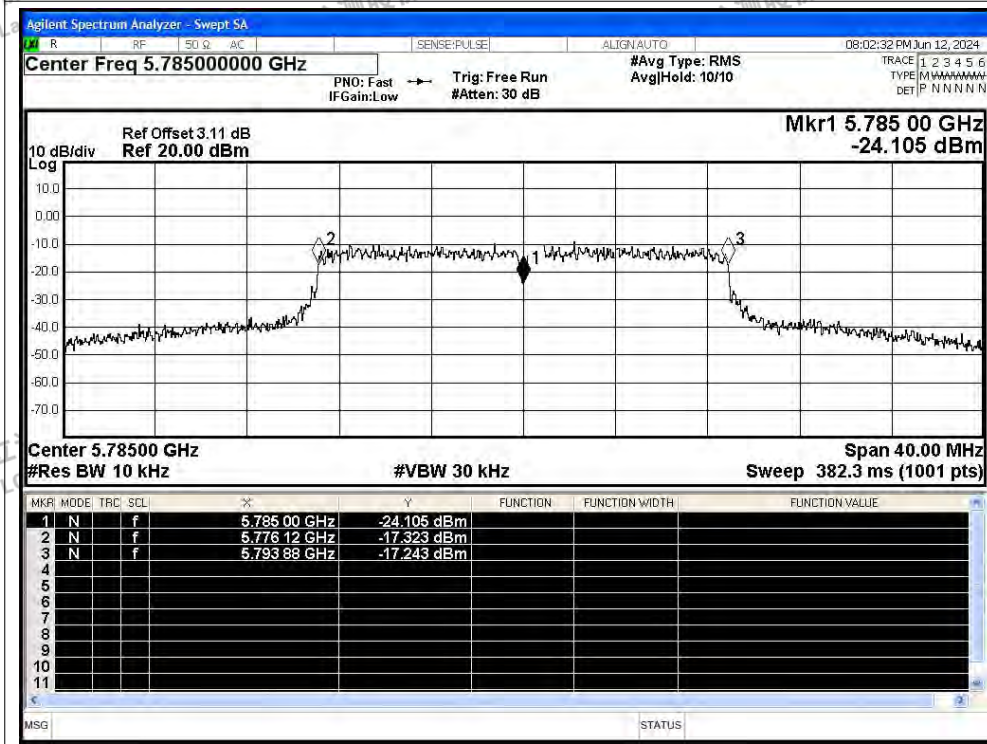

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant2

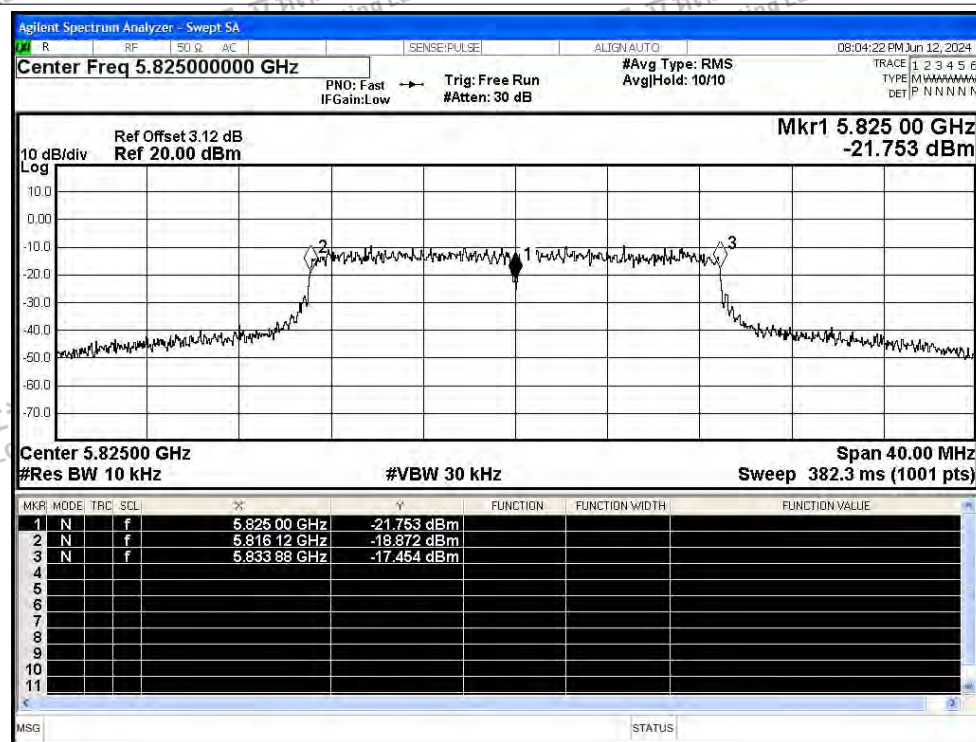

Freq. Stability NVNT ac40 5755MHz Ant2

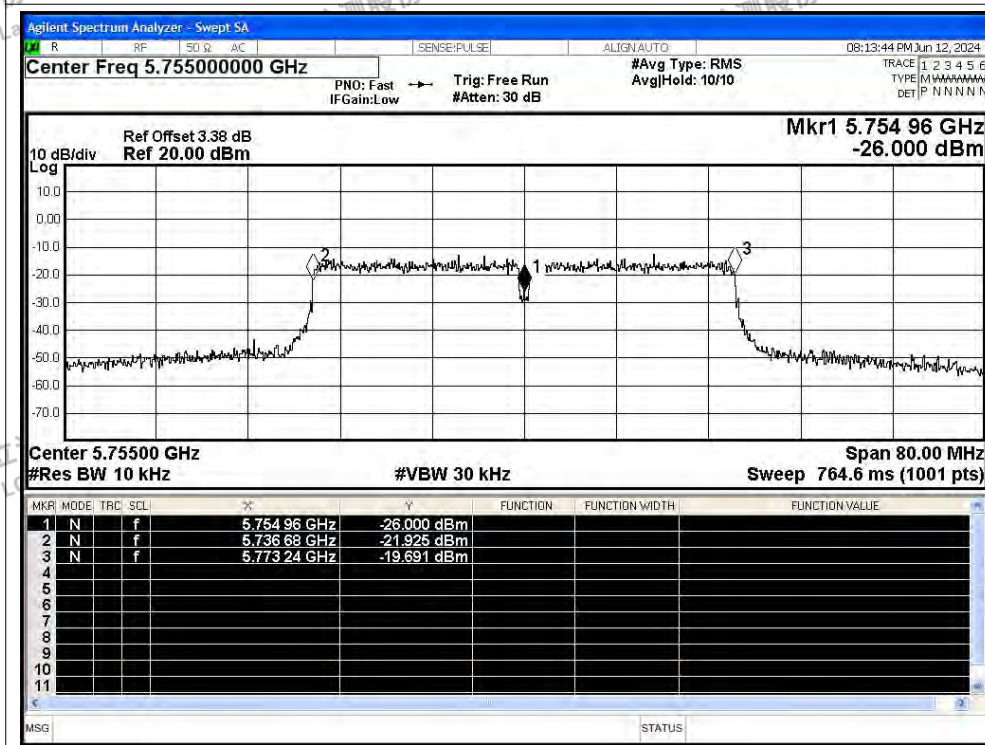

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant2

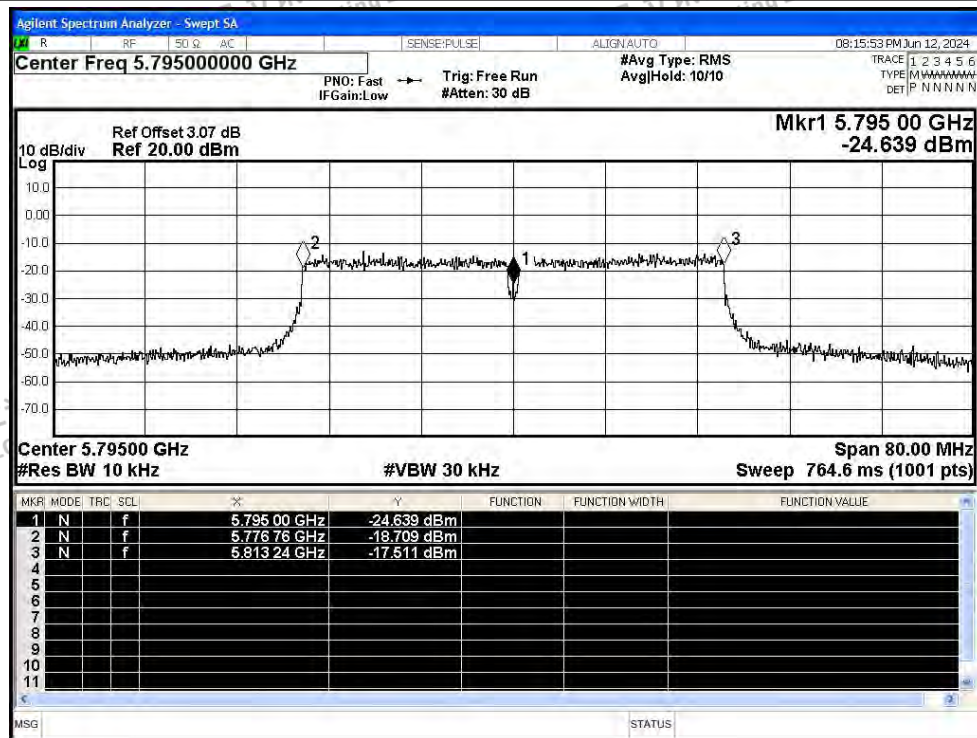

Freq. Stability NVNT ac80 5775MHz Ant2

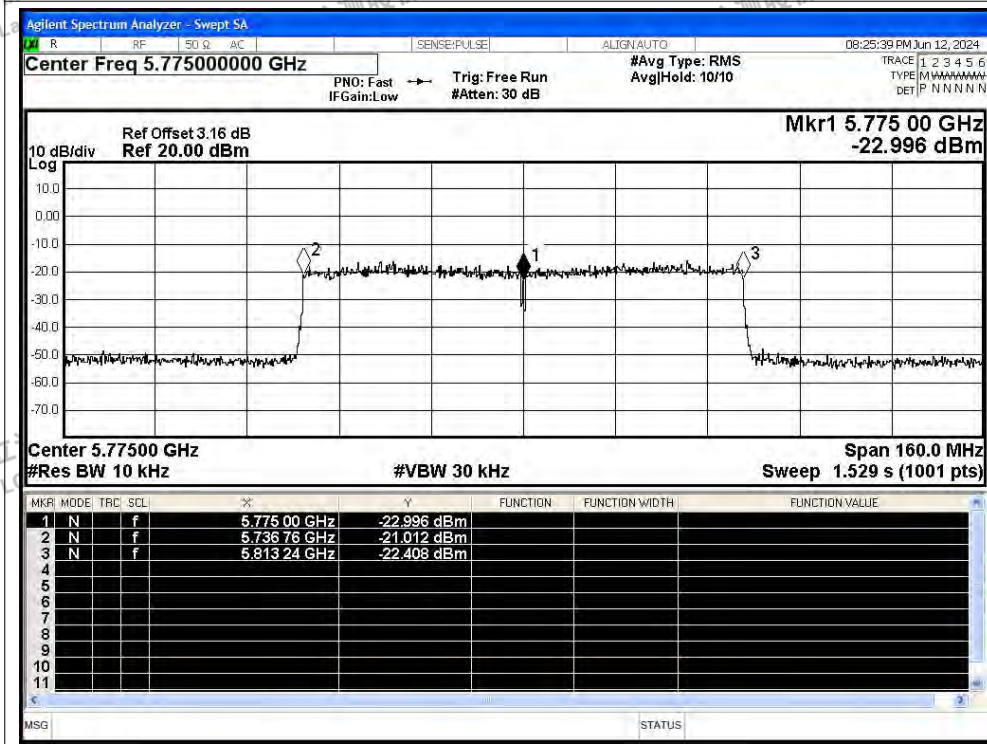

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant3	5745	0	0	25	Pass
NVNT	a	5785	Ant3	5785	0	0	25	Pass
NVNT	a	5825	Ant3	5825	0	0	25	Pass
NVNT	n20	5745	Ant3	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant3	5785.02	20000	3.46	25	Pass
NVNT	n20	5825	Ant3	5825	0	0	25	Pass
NVNT	n40	5755	Ant3	5755	0	0	25	Pass
NVNT	n40	5795	Ant3	5795	0	0	25	Pass
NVNT	ac20	5745	Ant3	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant3	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant3	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant3	5755	0	0	25	Pass
NVNT	ac40	5795	Ant3	5795	0	0	25	Pass
NVNT	ac80	5775	Ant3	5775	0	0	25	Pass
NVNT	ax20	5745	Ant3	5744.98	-20000	-3.48	25	Pass
NVNT	ax20	5785	Ant3	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant3	5825	0	0	25	Pass
NVNT	ax40	5755	Ant3	5755	0	0	25	Pass
NVNT	ax40	5795	Ant3	5795	0	0	25	Pass
NVNT	ax80	5775	Ant3	5775	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5745MHz Ant3

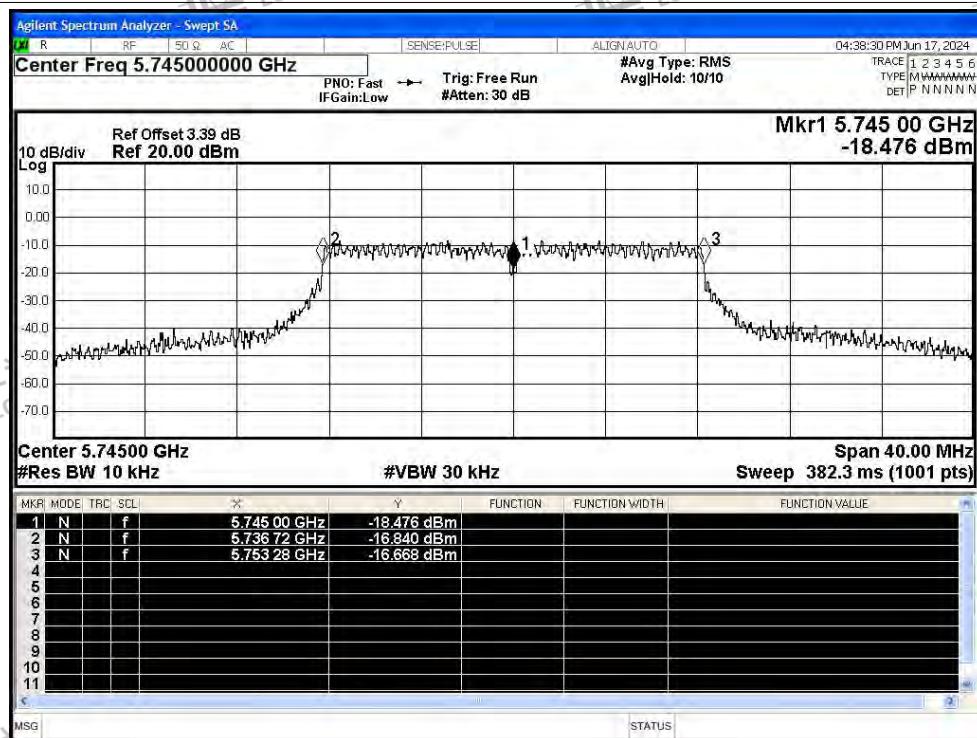

Freq. Stability NVNT a 5785MHz Ant3

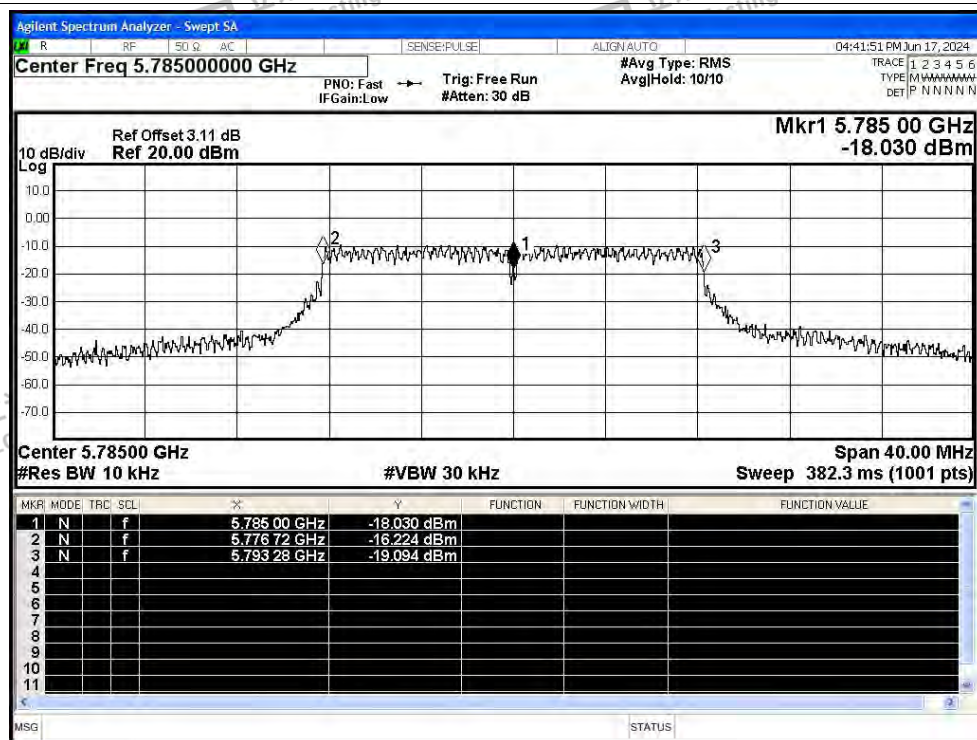

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant3

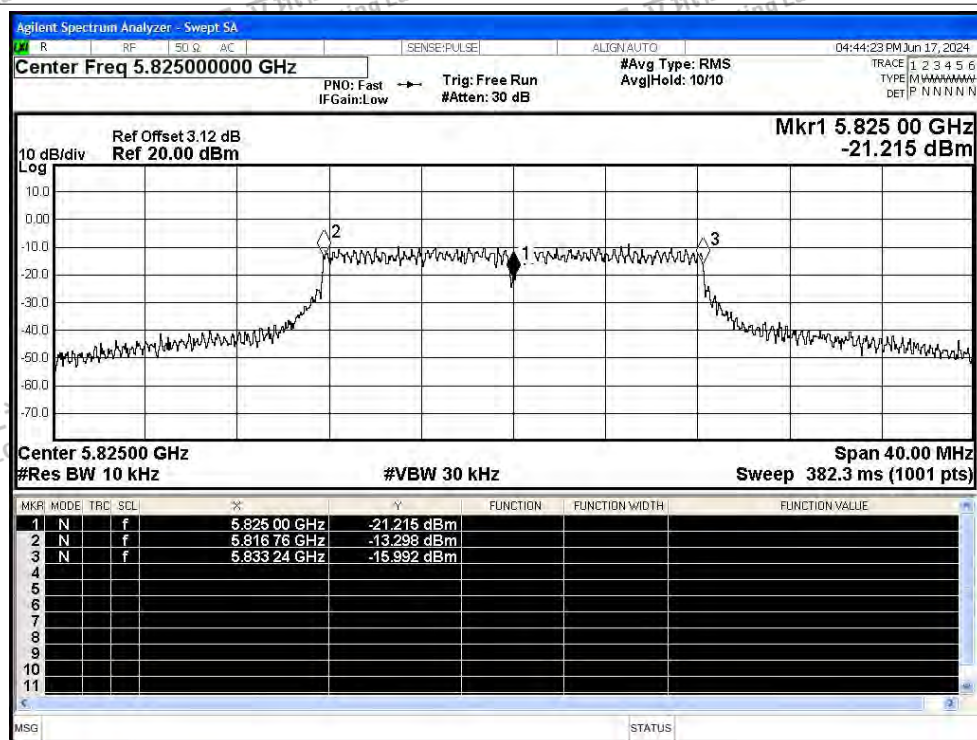

Freq. Stability NVNT n20 5745MHz Ant3

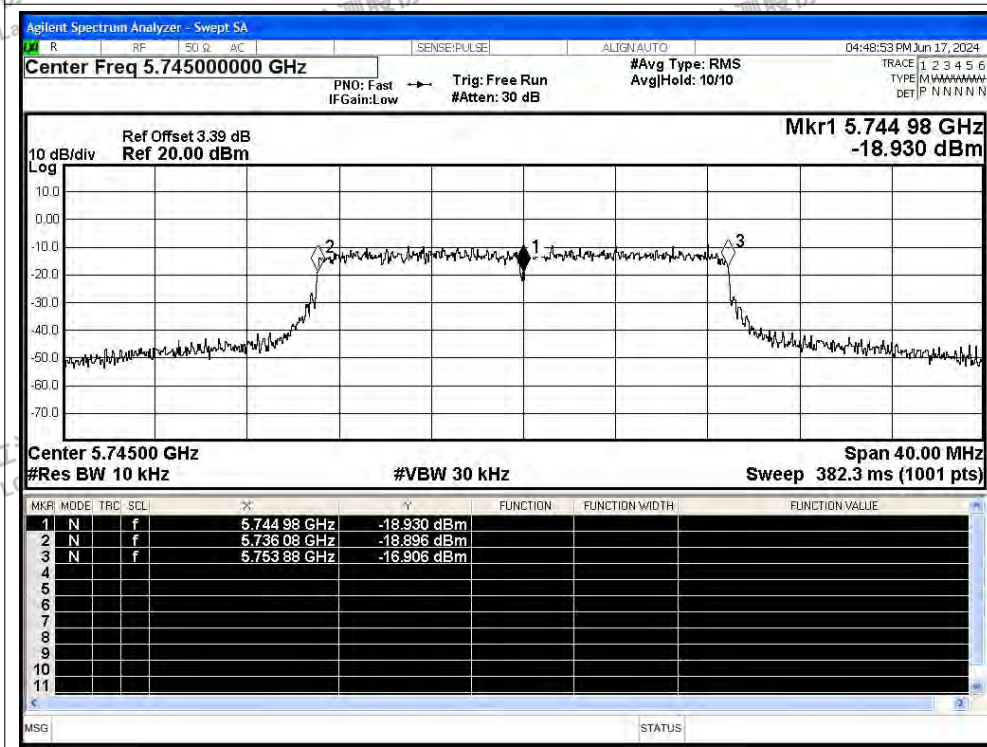

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant3

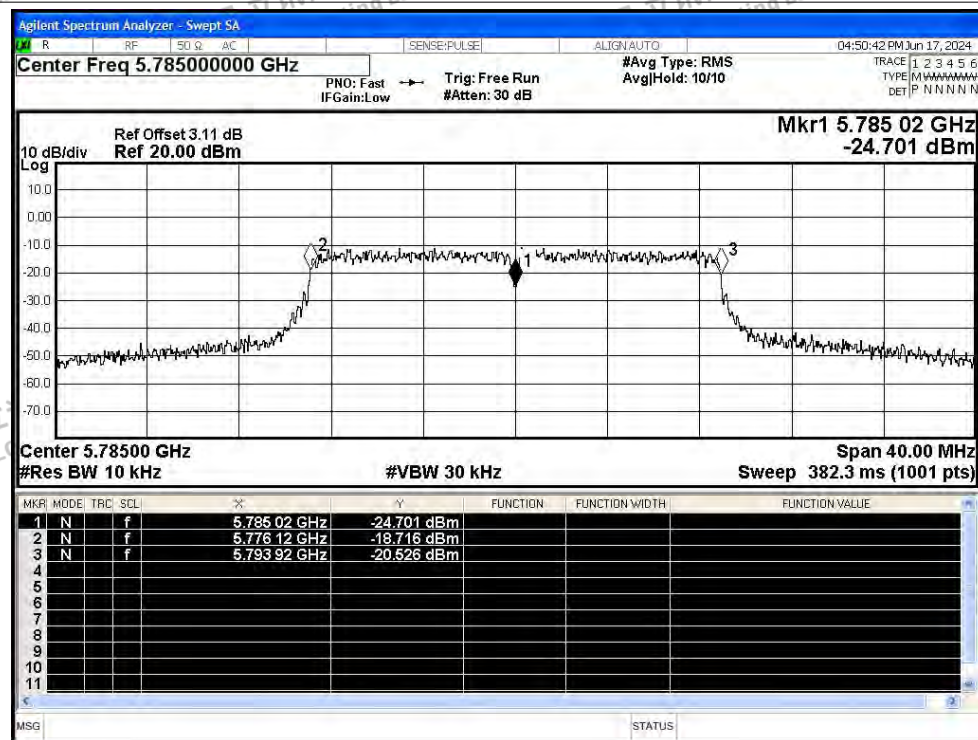

Freq. Stability NVNT n20 5825MHz Ant3

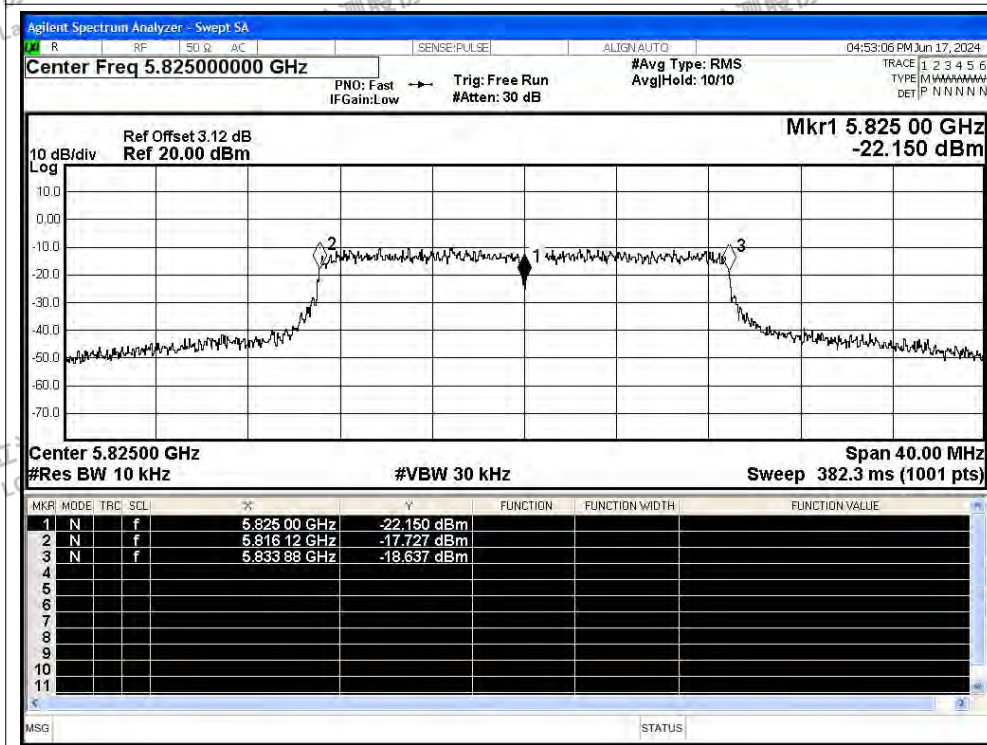

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5755MHz Ant3

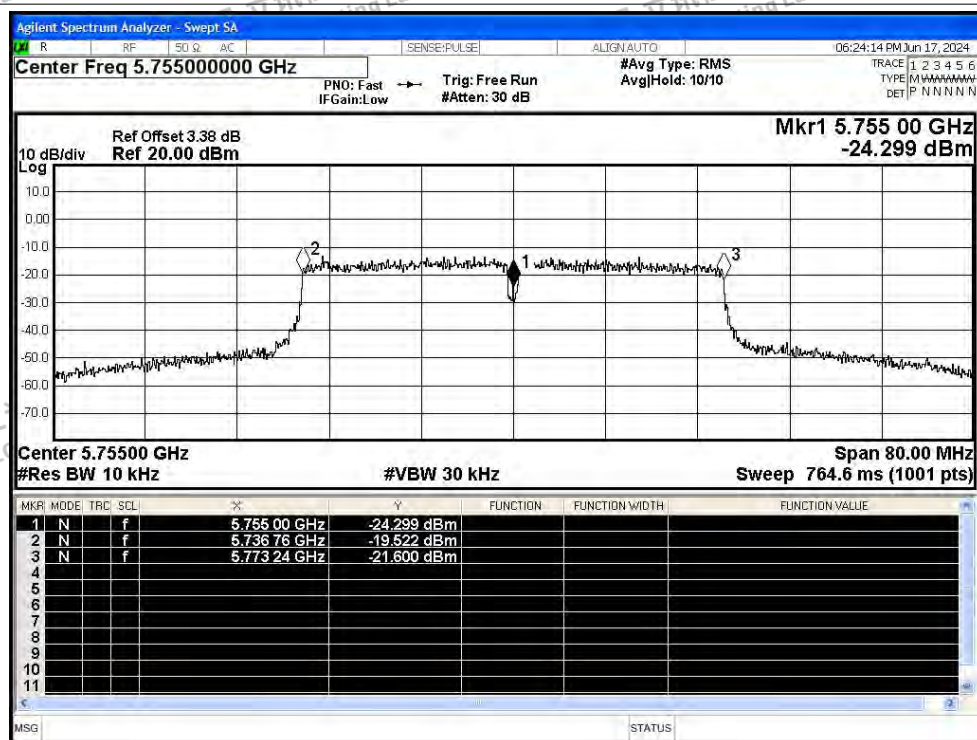

Freq. Stability NVNT n40 5795MHz Ant3

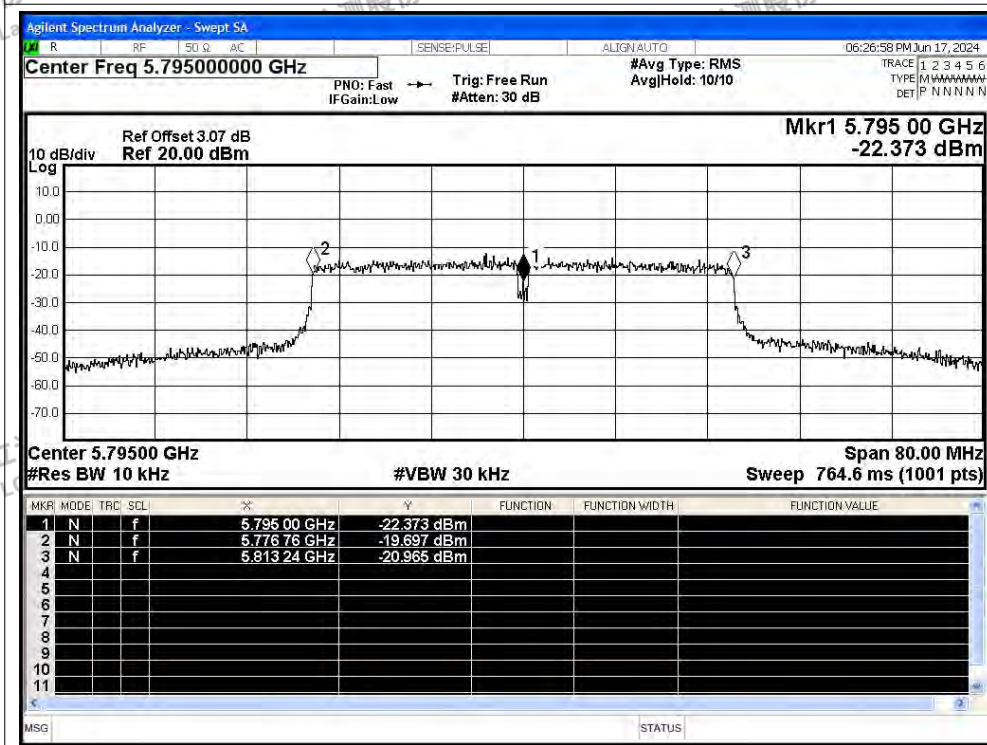

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5745MHz Ant3

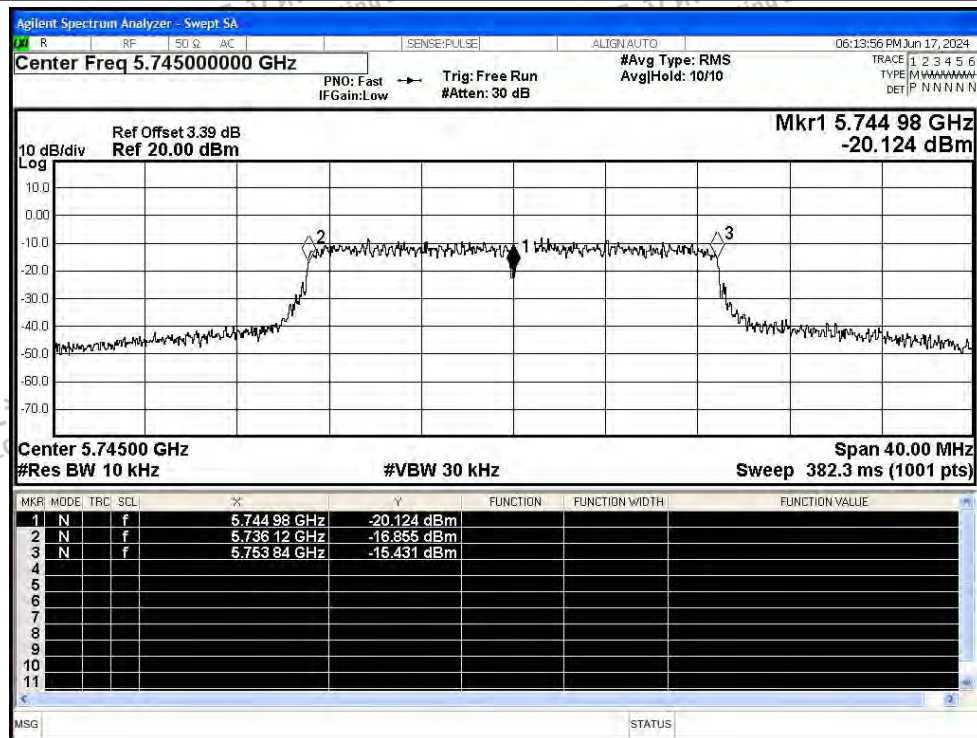

Freq. Stability NVNT ac20 5785MHz Ant3

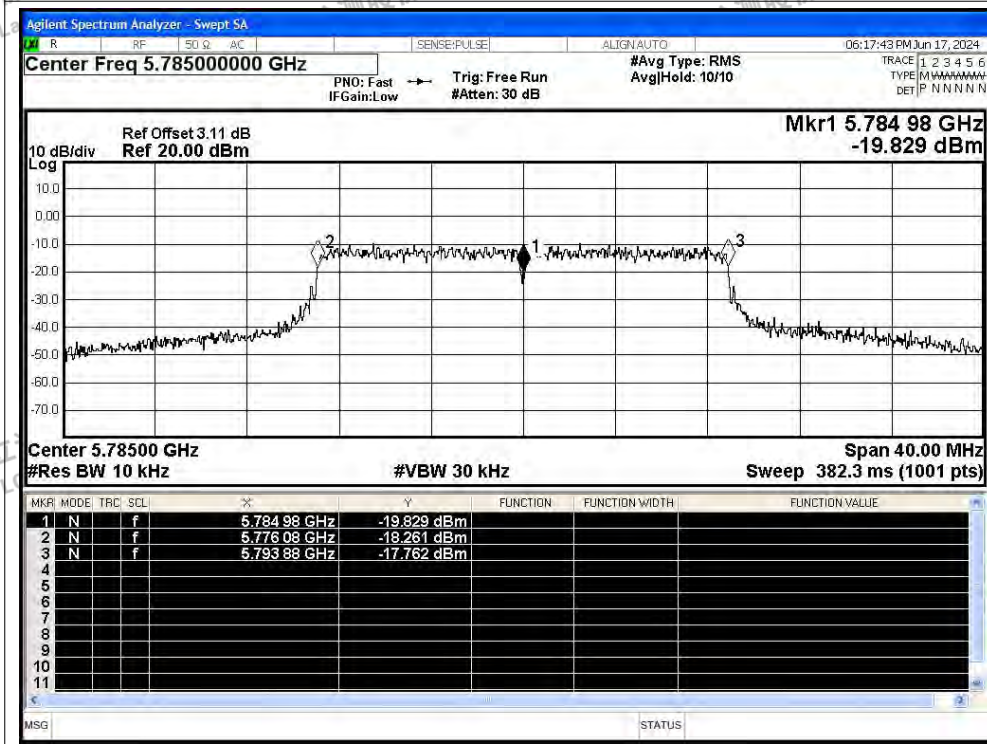

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5825MHz Ant3

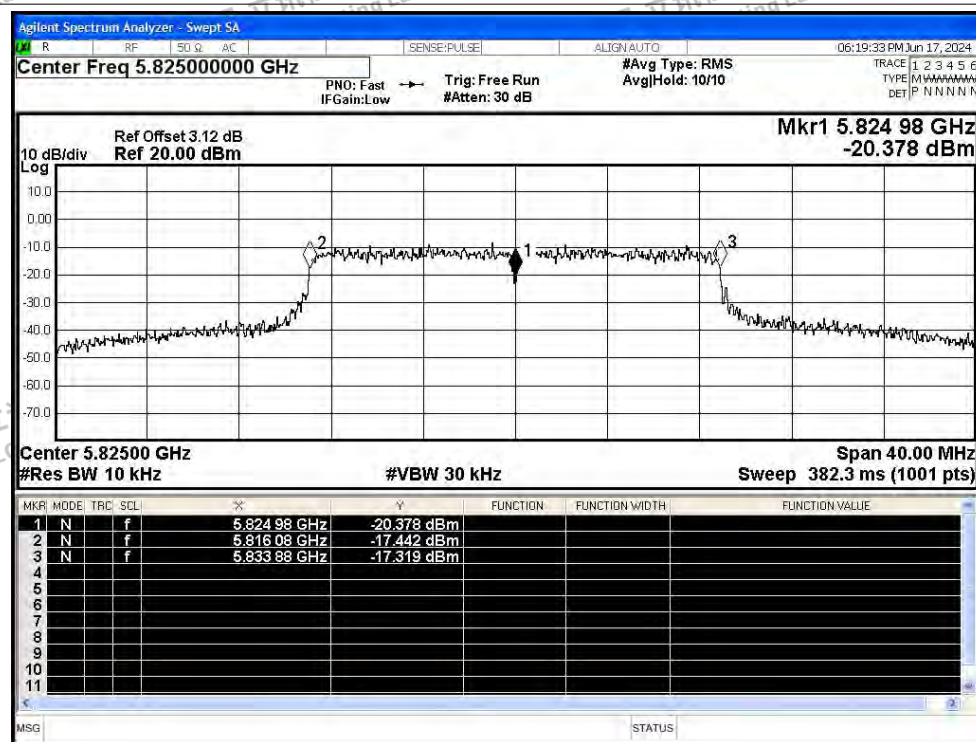

Freq. Stability NVNT ac40 5755MHz Ant3

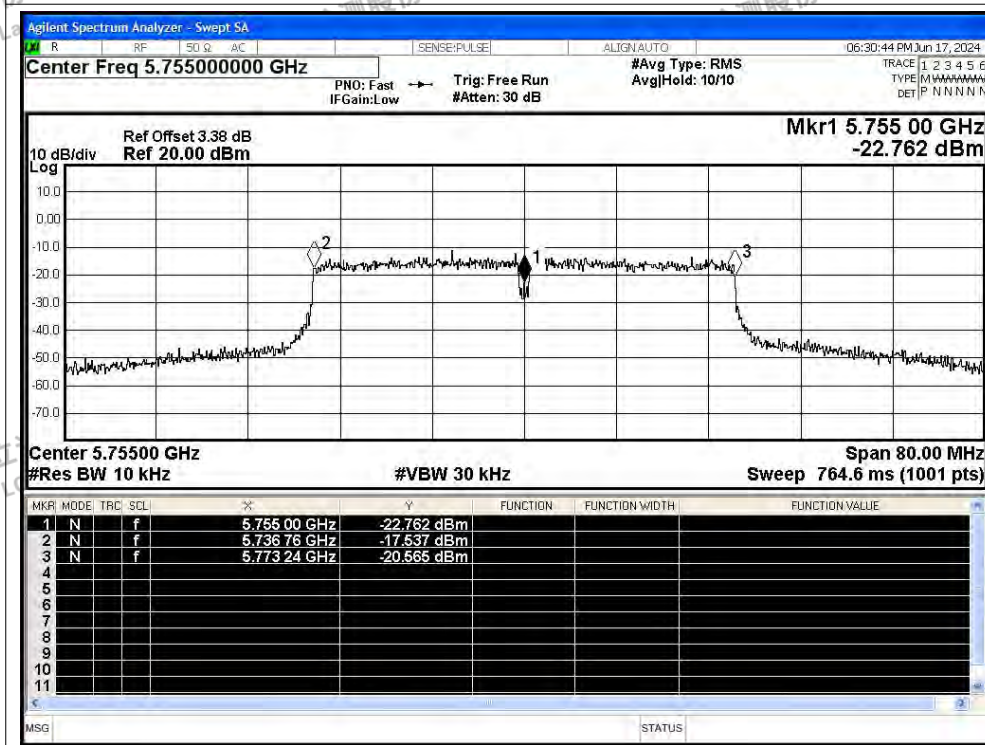

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5795MHz Ant3

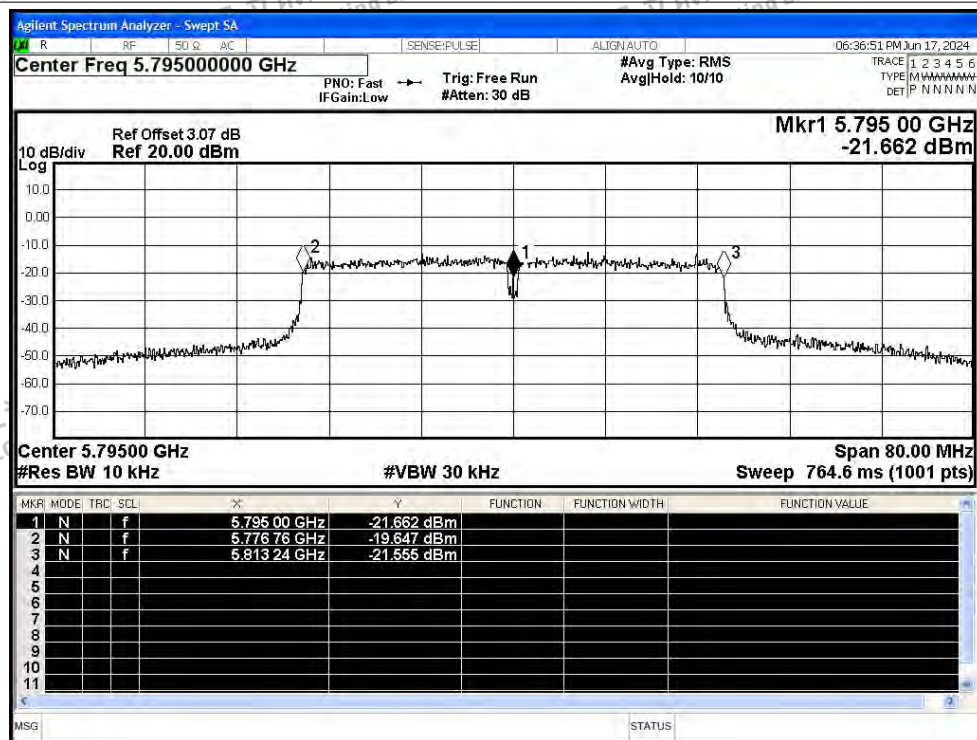

Freq. Stability NVNT ac80 5775MHz Ant3

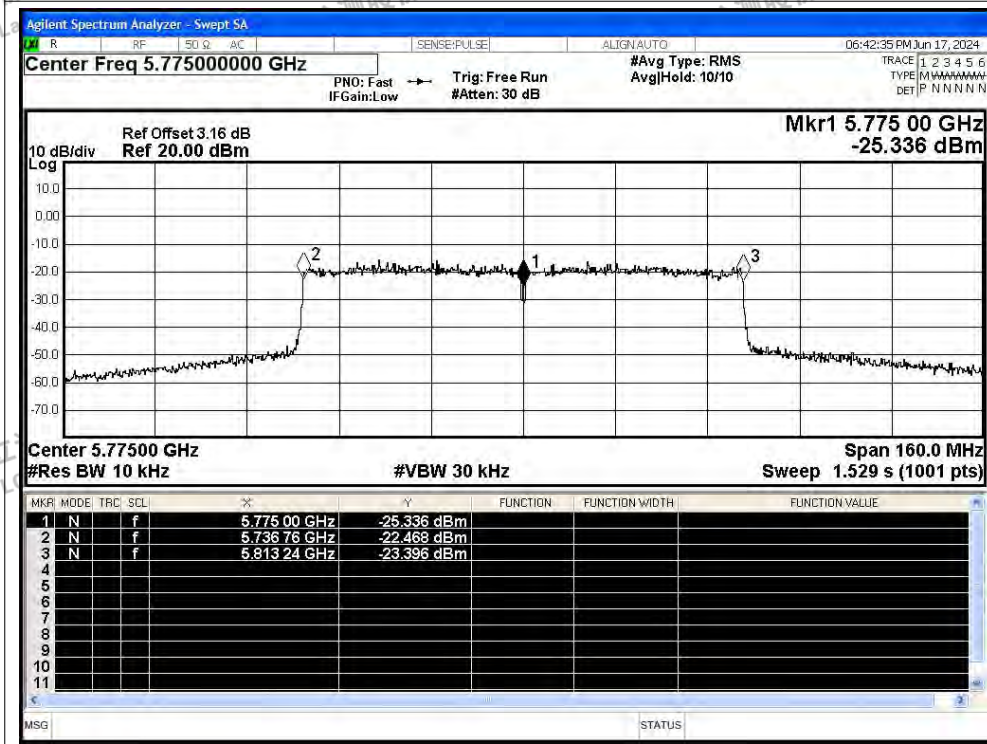

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5745MHz Ant3

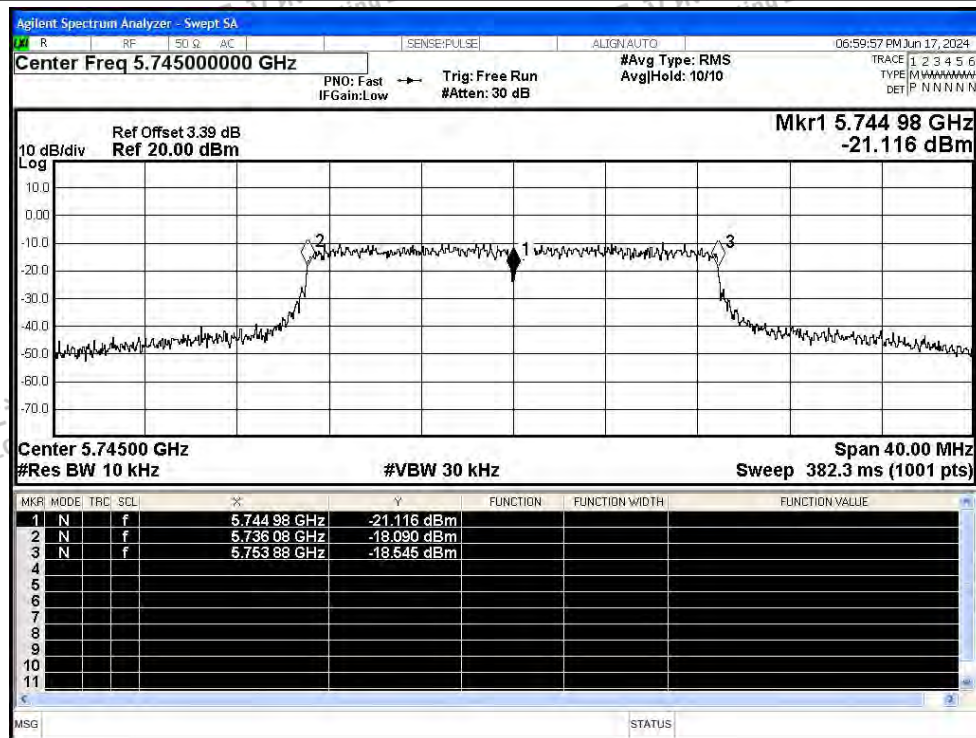

Freq. Stability NVNT ax20 5785MHz Ant3

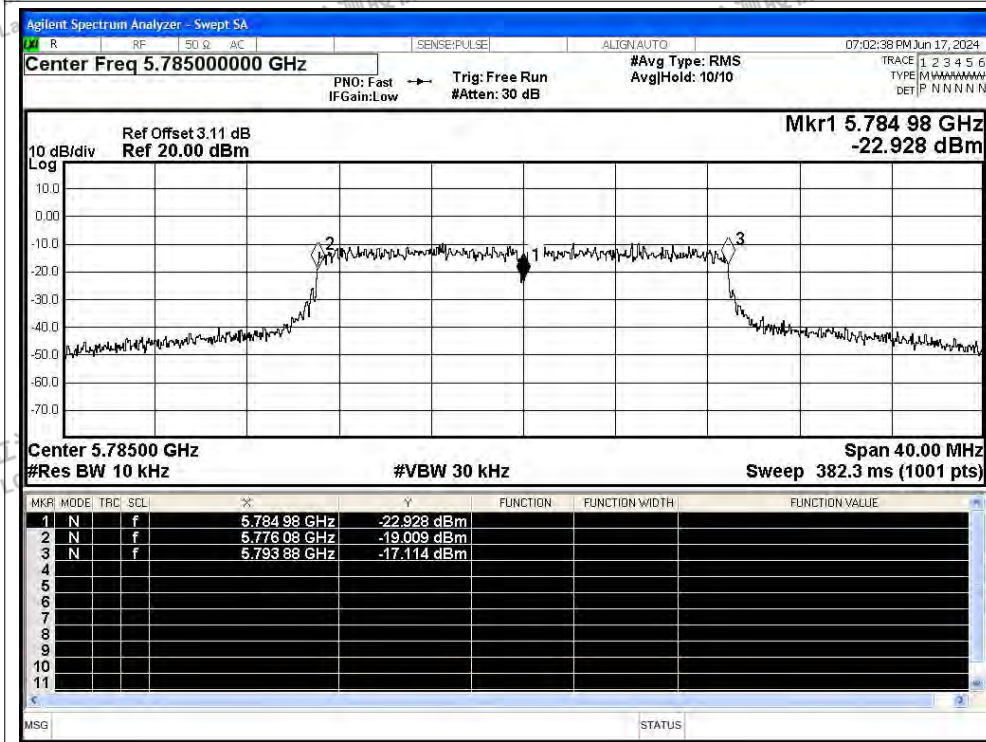

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5825MHz Ant3

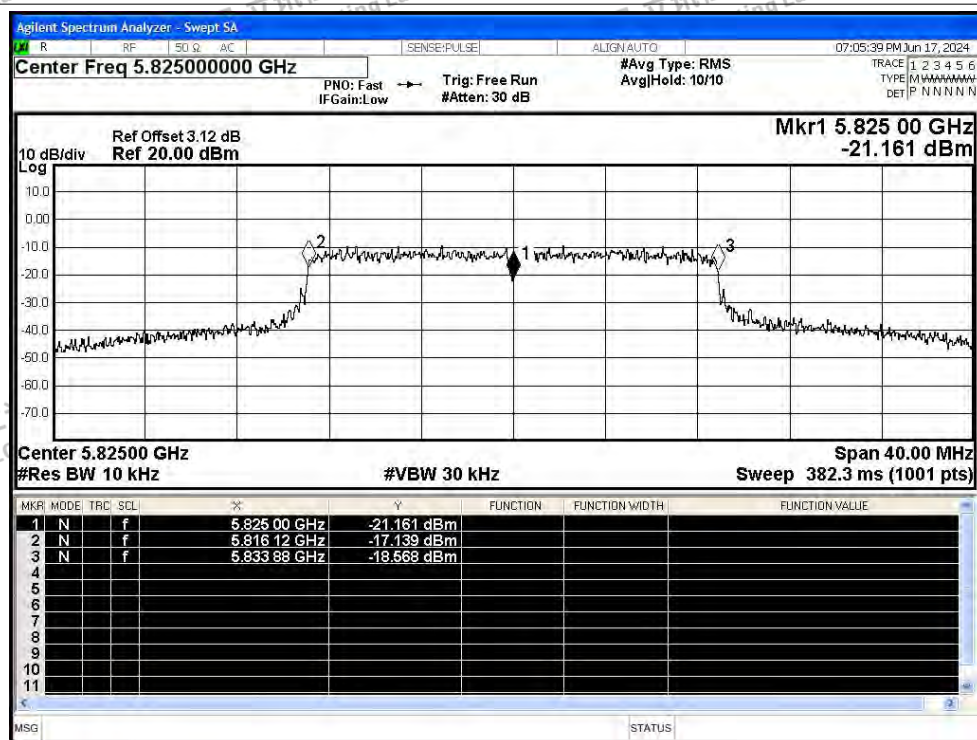

Freq. Stability NVNT ax40 5755MHz Ant3

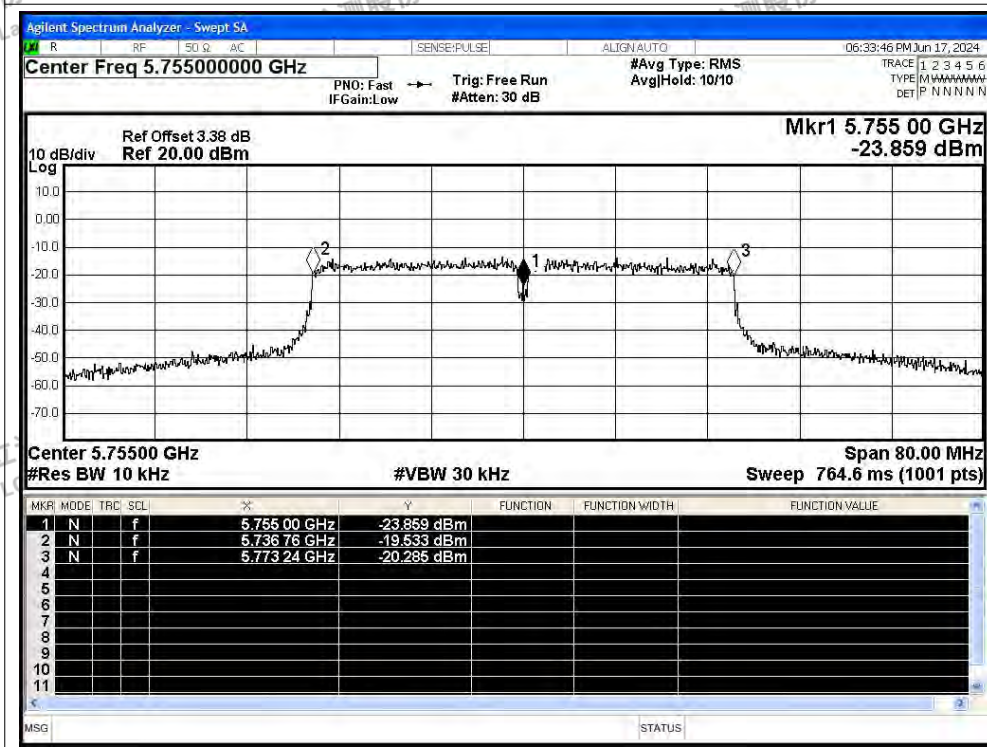

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5795MHz Ant3

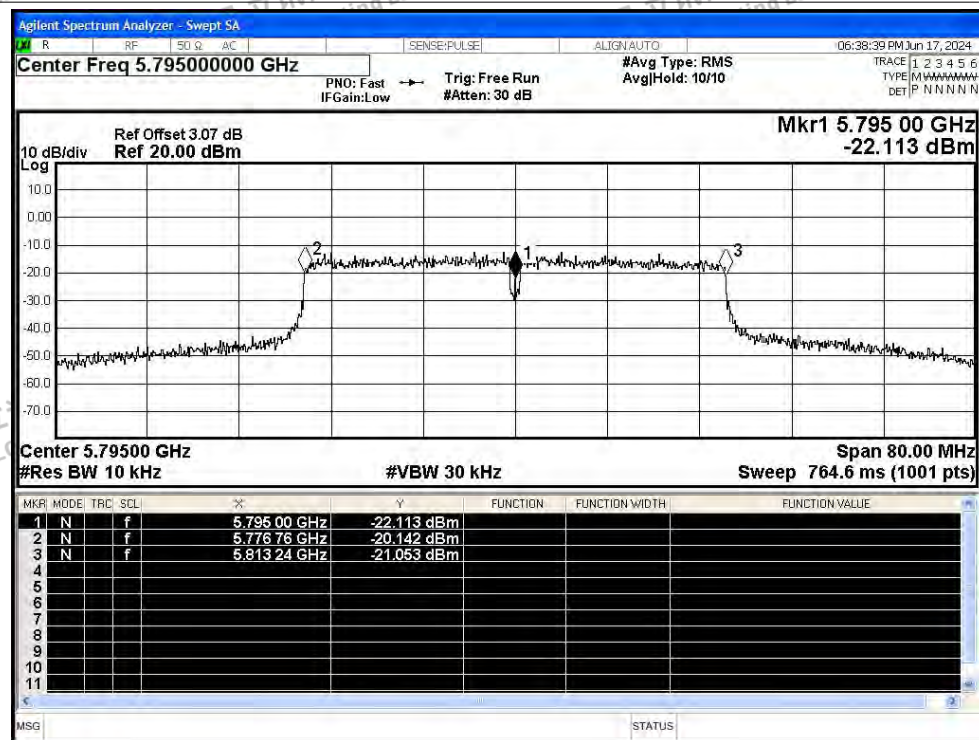

Freq. Stability NVNT ax80 5775MHz Ant3

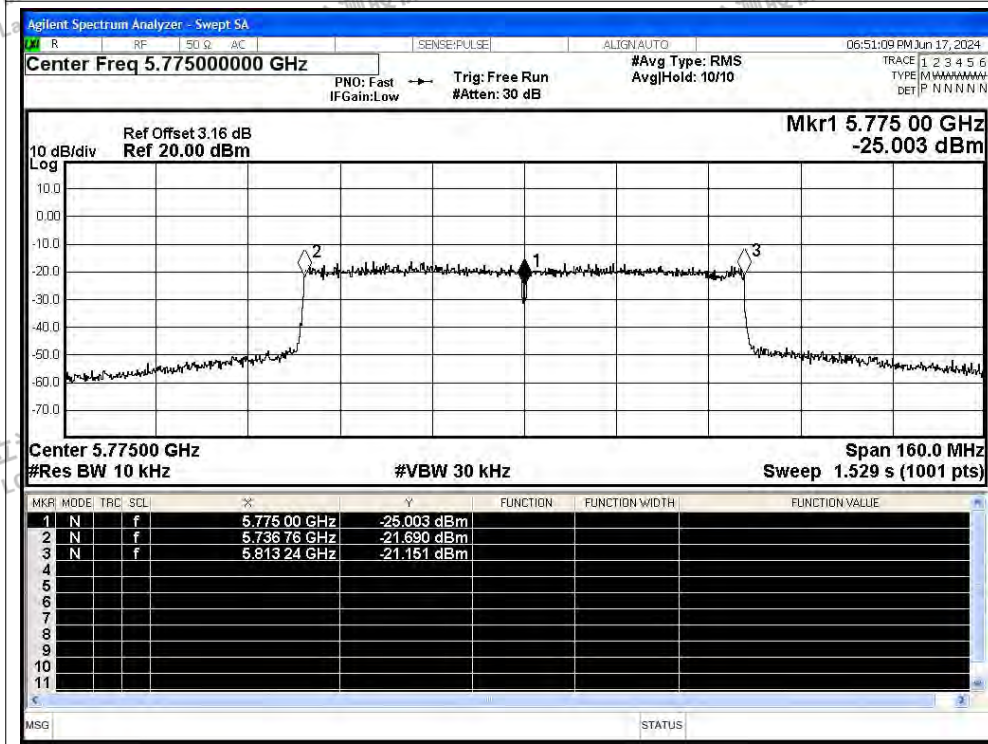

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5745	Ant4	5744.98	-20000	-3.48	25	Pass
NVNT	a	5785	Ant4	5785	0	0	25	Pass
NVNT	a	5825	Ant4	5824.98	-20000	-3.43	25	Pass
NVNT	n20	5745	Ant4	5744.98	-20000	-3.48	25	Pass
NVNT	n20	5785	Ant4	5785	0	0	25	Pass
NVNT	n20	5825	Ant4	5824.98	-20000	-3.43	25	Pass
NVNT	n40	5755	Ant4	5754.96	-40000	-6.95	25	Pass
NVNT	n40	5795	Ant4	5795	0	0	25	Pass
NVNT	ac20	5745	Ant4	5744.98	-20000	-3.48	25	Pass
NVNT	ac20	5785	Ant4	5784.98	-20000	-3.46	25	Pass
NVNT	ac20	5825	Ant4	5824.98	-20000	-3.43	25	Pass
NVNT	ac40	5755	Ant4	5754.96	-40000	-6.95	25	Pass
NVNT	ac40	5795	Ant4	5794.96	-40000	-6.9	25	Pass
NVNT	ac80	5775	Ant4	5775	0	0	25	Pass
NVNT	ax20	5745	Ant4	5744.96	-40000	-6.96	25	Pass
NVNT	ax20	5785	Ant4	5784.98	-20000	-3.46	25	Pass
NVNT	ax20	5825	Ant4	5824.98	-20000	-3.43	25	Pass
NVNT	ax40	5755	Ant4	5755	0	0	25	Pass
NVNT	ax40	5795	Ant4	5794.96	-40000	-6.9	25	Pass
NVNT	ax80	5775	Ant4	5775	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5745MHz Ant4

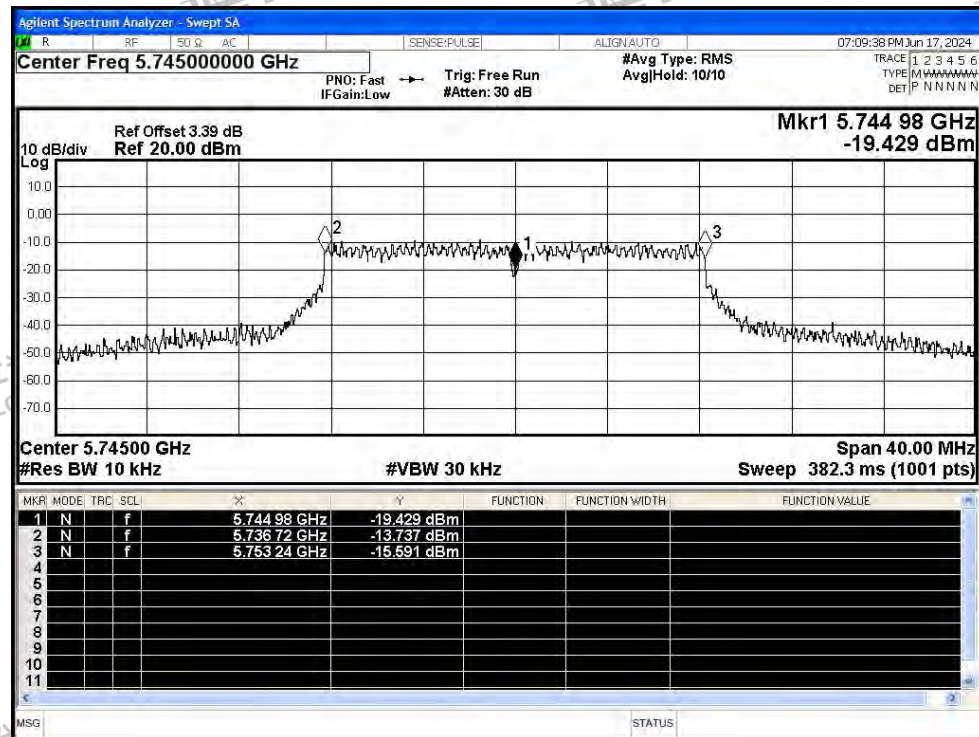

Freq. Stability NVNT a 5785MHz Ant4

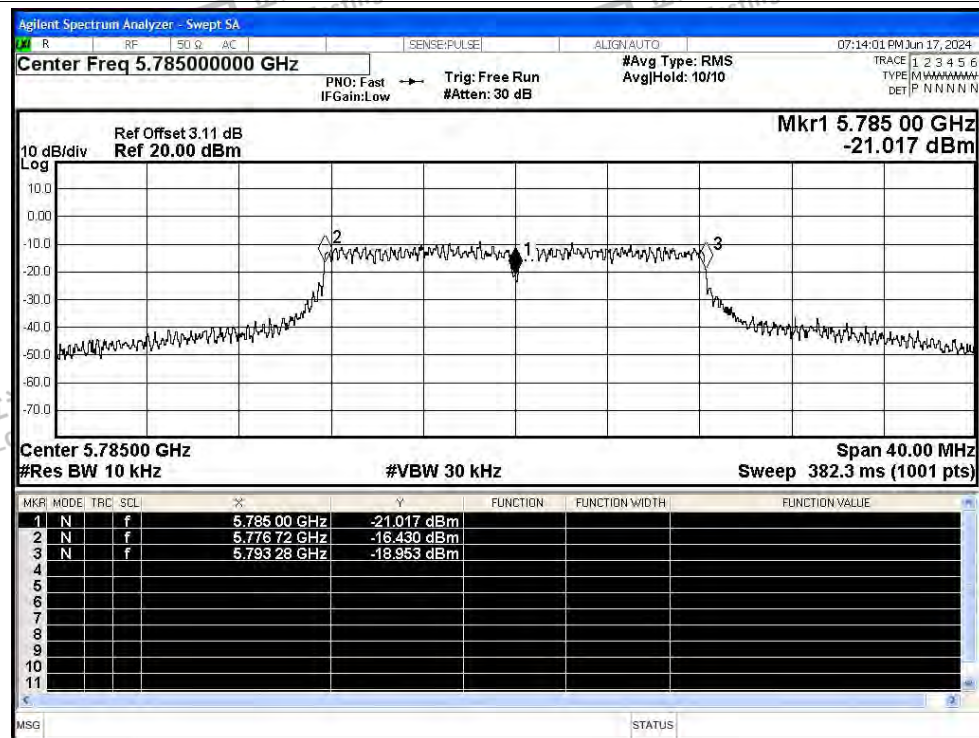

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5825MHz Ant4

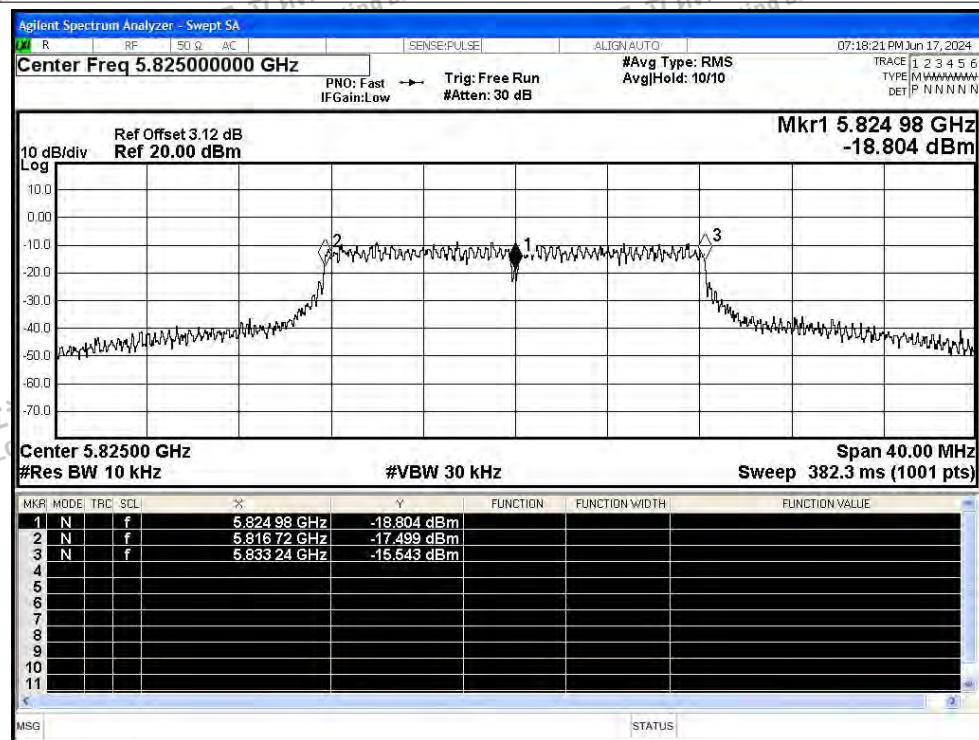

Freq. Stability NVNT n20 5745MHz Ant4

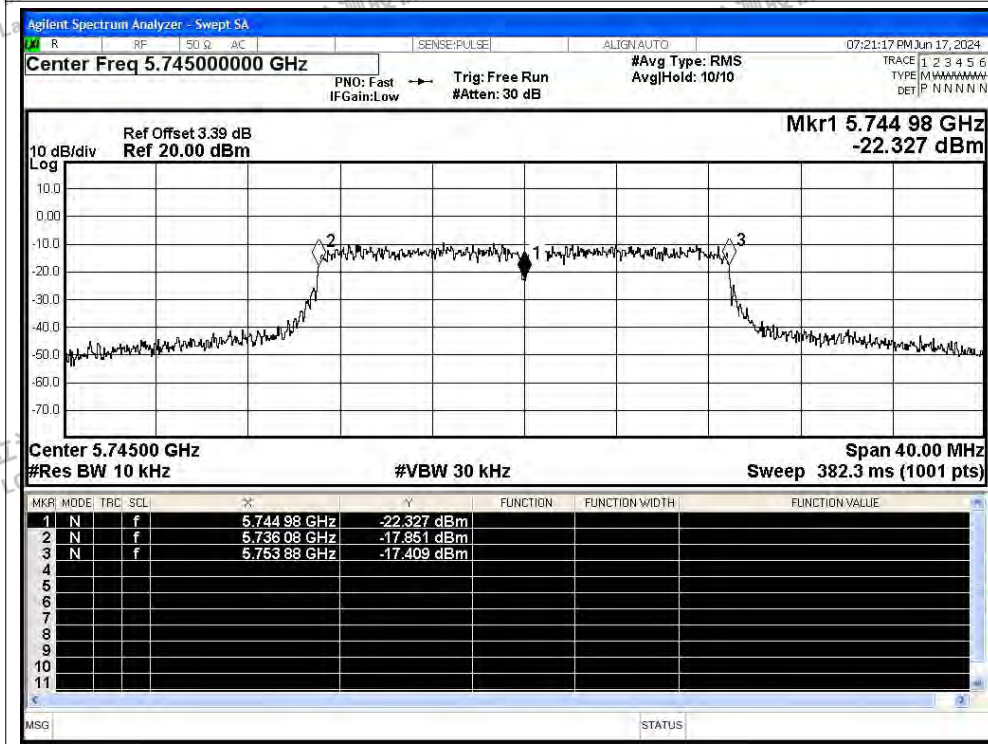

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5785MHz Ant4

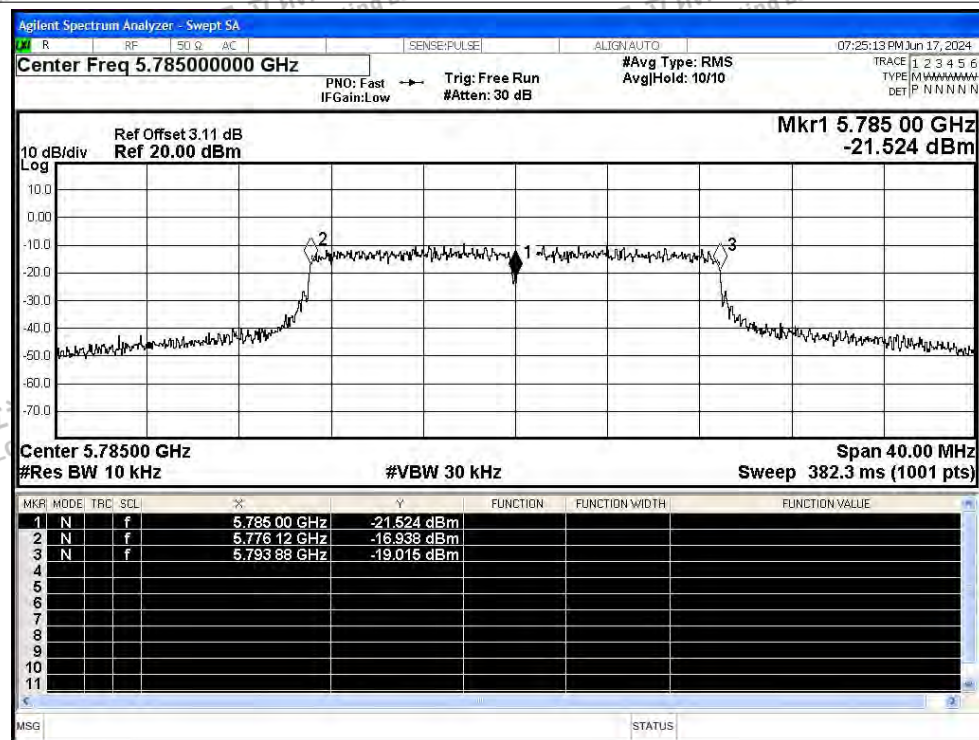

Freq. Stability NVNT n20 5825MHz Ant4

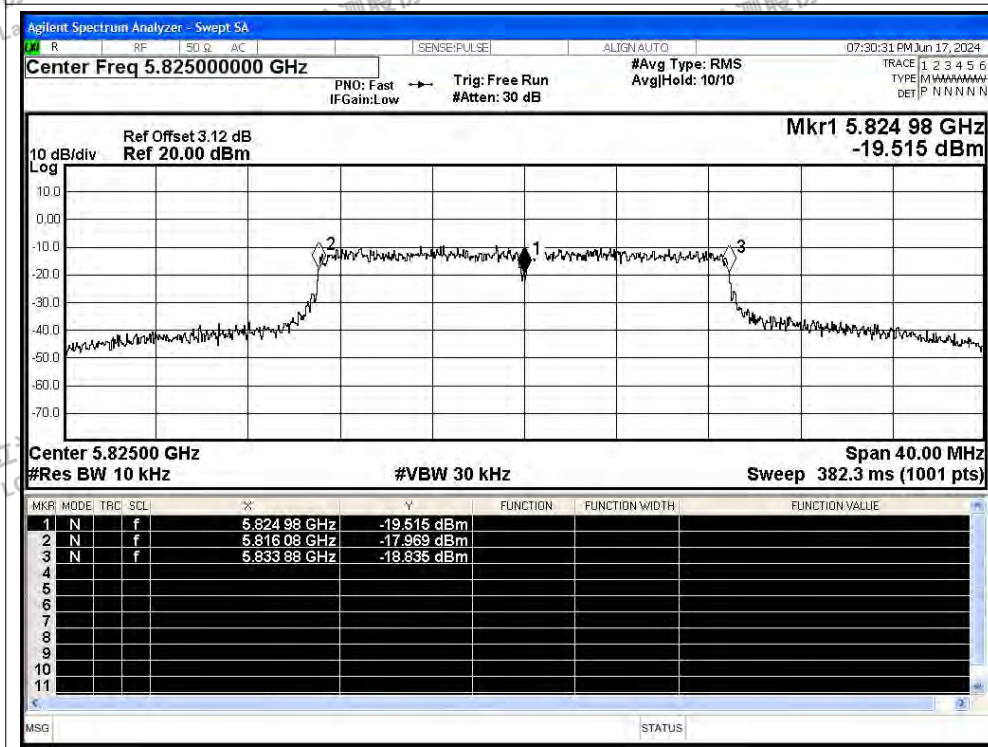

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity