



Appendix H Test Data for E-UTRA Band 41

Product Name: Smartphone

Test Model: UBS

Environmental Conditions

Temperature:	23.8° C
Relative Humidity:	52.1%
ATM Pressure:	100.0 kPa
Test Engineer:	Jay Luo
Supervised by:	Nick Peng



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



H.1 Conducted Power Output Data Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	22.49	PASS
Band41	5MHz	16QAM	39675	1RB#0	22.46	PASS
Band41	5MHz	QPSK	39675	1RB#12	22.35	PASS
Band41	5MHz	16QAM	39675	1RB#12	22.34	PASS
Band41	5MHz	QPSK	39675	1RB#24	21.98	PASS
Band41	5MHz	16QAM	39675	1RB#24	22.12	PASS
Band41	5MHz	QPSK	39675	12RB#0	21.30	PASS
Band41	5MHz	16QAM	39675	12RB#0	21.30	PASS
Band41	5MHz	QPSK	39675	12RB#6	21.30	PASS
Band41	5MHz	16QAM	39675	12RB#6	21.31	PASS
Band41	5MHz	QPSK	39675	12RB#13	21.31	PASS
Band41	5MHz	16QAM	39675	12RB#13	21.31	PASS
Band41	5MHz	QPSK	39675	25RB#0	21.31	PASS
Band41	5MHz	16QAM	39675	25RB#0	20.54	PASS
Band41	5MHz	QPSK	40620	1RB#0	22.19	PASS
Band41	5MHz	16QAM	40620	1RB#0	21.63	PASS
Band41	5MHz	QPSK	40620	1RB#12	21.92	PASS
Band41	5MHz	16QAM	40620	1RB#12	21.63	PASS
Band41	5MHz	QPSK	40620	1RB#24	21.83	PASS
Band41	5MHz	16QAM	40620	1RB#24	21.47	PASS
Band41	5MHz	QPSK	40620	12RB#0	20.96	PASS
Band41	5MHz	16QAM	40620	12RB#0	20.97	PASS
Band41	5MHz	QPSK	40620	12RB#6	20.97	PASS
Band41	5MHz	16QAM	40620	12RB#6	20.97	PASS
Band41	5MHz	QPSK	40620	12RB#13	20.98	PASS
Band41	5MHz	16QAM	40620	12RB#13	20.98	PASS
Band41	5MHz	QPSK	40620	25RB#0	20.99	PASS
Band41	5MHz	16QAM	40620	25RB#0	20.30	PASS
Band41	5MHz	QPSK	41565	1RB#0	22.83	PASS
Band41	5MHz	16QAM	41565	1RB#0	22.67	PASS
Band41	5MHz	QPSK	41565	1RB#12	23.06	PASS
Band41	5MHz	16QAM	41565	1RB#12	22.73	PASS
Band41	5MHz	QPSK	41565	1RB#24	22.71	PASS
Band41	5MHz	16QAM	41565	1RB#24	22.78	PASS
Band41	5MHz	QPSK	41565	12RB#0	22.38	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	12RB#0	22.39	PASS
Band41	5MHz	QPSK	41565	12RB#6	22.39	PASS
Band41	5MHz	16QAM	41565	12RB#6	22.40	PASS
Band41	5MHz	QPSK	41565	12RB#13	22.40	PASS
Band41	5MHz	16QAM	41565	12RB#13	22.40	PASS
Band41	5MHz	QPSK	41565	25RB#0	22.40	PASS
Band41	5MHz	16QAM	41565	25RB#0	21.62	PASS
Band41	10MHz	QPSK	39700	1RB#0	22.82	PASS
Band41	10MHz	16QAM	39700	1RB#0	22.28	PASS
Band41	10MHz	QPSK	39700	1RB#24	22.65	PASS
Band41	10MHz	16QAM	39700	1RB#24	22.06	PASS
Band41	10MHz	QPSK	39700	1RB#49	22.71	PASS
Band41	10MHz	16QAM	39700	1RB#49	22.11	PASS
Band41	10MHz	QPSK	39700	25RB#0	21.87	PASS
Band41	10MHz	16QAM	39700	25RB#0	21.86	PASS
Band41	10MHz	QPSK	39700	25RB#12	21.86	PASS
Band41	10MHz	16QAM	39700	25RB#12	21.86	PASS
Band41	10MHz	QPSK	39700	25RB#25	21.85	PASS
Band41	10MHz	16QAM	39700	25RB#25	22.17	PASS
Band41	10MHz	QPSK	39700	50RB#0	22.16	PASS
Band41	10MHz	16QAM	39700	50RB#0	21.44	PASS
Band41	10MHz	QPSK	40620	1RB#0	23.24	PASS
Band41	10MHz	16QAM	40620	1RB#0	22.71	PASS
Band41	10MHz	QPSK	40620	1RB#24	23.06	PASS
Band41	10MHz	16QAM	40620	1RB#24	22.40	PASS
Band41	10MHz	QPSK	40620	1RB#49	22.59	PASS
Band41	10MHz	16QAM	40620	1RB#49	22.01	PASS
Band41	10MHz	QPSK	40620	25RB#0	22.19	PASS
Band41	10MHz	16QAM	40620	25RB#0	22.20	PASS
Band41	10MHz	QPSK	40620	25RB#12	22.20	PASS
Band41	10MHz	16QAM	40620	25RB#12	22.20	PASS
Band41	10MHz	QPSK	40620	25RB#25	21.71	PASS
Band41	10MHz	16QAM	40620	25RB#25	21.71	PASS
Band41	10MHz	QPSK	40620	50RB#0	21.96	PASS
Band41	10MHz	16QAM	40620	50RB#0	21.12	PASS
Band41	10MHz	QPSK	41540	1RB#0	22.85	PASS
Band41	10MHz	16QAM	41540	1RB#0	22.75	PASS
Band41	10MHz	QPSK	41540	1RB#24	22.86	PASS
Band41	10MHz	16QAM	41540	1RB#24	22.76	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	10MHz	QPSK	41540	1RB#49	22.82	PASS
Band41	10MHz	16QAM	41540	1RB#49	22.66	PASS
Band41	10MHz	QPSK	41540	25RB#0	21.86	PASS
Band41	10MHz	16QAM	41540	25RB#0	21.83	PASS
Band41	10MHz	QPSK	41540	25RB#12	21.83	PASS
Band41	10MHz	16QAM	41540	25RB#12	21.84	PASS
Band41	10MHz	QPSK	41540	25RB#25	21.82	PASS
Band41	10MHz	16QAM	41540	25RB#25	21.82	PASS
Band41	10MHz	QPSK	41540	50RB#0	21.83	PASS
Band41	10MHz	16QAM	41540	50RB#0	20.97	PASS
Band41	15MHz	QPSK	39725	1RB#0	23.31	PASS
Band41	15MHz	16QAM	39725	1RB#0	23.02	PASS
Band41	15MHz	QPSK	39725	1RB#38	23.11	PASS
Band41	15MHz	16QAM	39725	1RB#38	22.90	PASS
Band41	15MHz	QPSK	39725	1RB#74	23.43	PASS
Band41	15MHz	16QAM	39725	1RB#74	23.13	PASS
Band41	15MHz	QPSK	39725	38RB#0	22.21	PASS
Band41	15MHz	16QAM	39725	38RB#0	22.21	PASS
Band41	15MHz	QPSK	39725	38RB#18	22.20	PASS
Band41	15MHz	16QAM	39725	38RB#18	22.20	PASS
Band41	15MHz	QPSK	39725	38RB#37	22.20	PASS
Band41	15MHz	16QAM	39725	38RB#37	22.28	PASS
Band41	15MHz	QPSK	39725	75RB#0	22.28	PASS
Band41	15MHz	16QAM	39725	75RB#0	21.53	PASS
Band41	15MHz	QPSK	40620	1RB#0	23.72	PASS
Band41	15MHz	16QAM	40620	1RB#0	22.22	PASS
Band41	15MHz	QPSK	40620	1RB#38	23.38	PASS
Band41	15MHz	16QAM	40620	1RB#38	21.77	PASS
Band41	15MHz	QPSK	40620	1RB#74	22.93	PASS
Band41	15MHz	16QAM	40620	1RB#74	21.41	PASS
Band41	15MHz	QPSK	40620	38RB#0	22.14	PASS
Band41	15MHz	16QAM	40620	38RB#0	22.14	PASS
Band41	15MHz	QPSK	40620	38RB#18	22.14	PASS
Band41	15MHz	16QAM	40620	38RB#18	22.14	PASS
Band41	15MHz	QPSK	40620	38RB#37	22.14	PASS
Band41	15MHz	16QAM	40620	38RB#37	22.14	PASS
Band41	15MHz	QPSK	40620	75RB#0	22.14	PASS
Band41	15MHz	16QAM	40620	75RB#0	21.46	PASS
Band41	15MHz	QPSK	41515	1RB#0	22.84	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	16QAM	41515	1RB#0	22.72	PASS
Band41	15MHz	QPSK	41515	1RB#38	22.96	PASS
Band41	15MHz	16QAM	41515	1RB#38	22.72	PASS
Band41	15MHz	QPSK	41515	1RB#74	22.77	PASS
Band41	15MHz	16QAM	41515	1RB#74	22.61	PASS
Band41	15MHz	QPSK	41515	38RB#0	21.88	PASS
Band41	15MHz	16QAM	41515	38RB#0	21.88	PASS
Band41	15MHz	QPSK	41515	38RB#18	21.88	PASS
Band41	15MHz	16QAM	41515	38RB#18	21.88	PASS
Band41	15MHz	QPSK	41515	38RB#37	21.88	PASS
Band41	15MHz	16QAM	41515	38RB#37	21.89	PASS
Band41	15MHz	QPSK	41515	75RB#0	21.89	PASS
Band41	15MHz	16QAM	41515	75RB#0	21.25	PASS
Band41	20MHz	QPSK	39750	1RB#0	23.04	PASS
Band41	20MHz	16QAM	39750	1RB#0	22.31	PASS
Band41	20MHz	QPSK	39750	1RB#49	22.75	PASS
Band41	20MHz	16QAM	39750	1RB#49	22.22	PASS
Band41	20MHz	QPSK	39750	1RB#99	23.28	PASS
Band41	20MHz	16QAM	39750	1RB#99	22.96	PASS
Band41	20MHz	QPSK	39750	50RB#0	21.83	PASS
Band41	20MHz	16QAM	39750	50RB#0	21.26	PASS
Band41	20MHz	QPSK	39750	50RB#25	21.82	PASS
Band41	20MHz	16QAM	39750	50RB#25	21.25	PASS
Band41	20MHz	QPSK	39750	50RB#50	22.21	PASS
Band41	20MHz	16QAM	39750	50RB#50	21.61	PASS
Band41	20MHz	QPSK	39750	100RB#0	21.95	PASS
Band41	20MHz	16QAM	39750	100RB#0	21.29	PASS
Band41	20MHz	QPSK	40620	1RB#0	23.60	PASS
Band41	20MHz	16QAM	40620	1RB#0	22.75	PASS
Band41	20MHz	QPSK	40620	1RB#49	23.16	PASS
Band41	20MHz	16QAM	40620	1RB#49	22.36	PASS
Band41	20MHz	QPSK	40620	1RB#99	22.55	PASS
Band41	20MHz	16QAM	40620	1RB#99	21.66	PASS
Band41	20MHz	QPSK	40620	50RB#0	22.43	PASS
Band41	20MHz	16QAM	40620	50RB#0	21.67	PASS
Band41	20MHz	QPSK	40620	50RB#25	22.44	PASS
Band41	20MHz	16QAM	40620	50RB#25	21.61	PASS
Band41	20MHz	QPSK	40620	50RB#50	21.76	PASS
Band41	20MHz	16QAM	40620	50RB#50	21.08	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	40620	100RB#0	22.12	PASS
Band41	20MHz	16QAM	40620	100RB#0	21.42	PASS
Band41	20MHz	QPSK	41490	1RB#0	22.88	PASS
Band41	20MHz	16QAM	41490	1RB#0	21.88	PASS
Band41	20MHz	QPSK	41490	1RB#49	23.00	PASS
Band41	20MHz	16QAM	41490	1RB#49	21.97	PASS
Band41	20MHz	QPSK	41490	1RB#99	22.85	PASS
Band41	20MHz	16QAM	41490	1RB#99	21.92	PASS
Band41	20MHz	QPSK	41490	50RB#0	21.90	PASS
Band41	20MHz	16QAM	41490	50RB#0	21.08	PASS
Band41	20MHz	QPSK	41490	50RB#25	21.91	PASS
Band41	20MHz	16QAM	41490	50RB#25	21.13	PASS
Band41	20MHz	QPSK	41490	50RB#50	21.78	PASS
Band41	20MHz	16QAM	41490	50RB#50	20.95	PASS
Band41	20MHz	QPSK	41490	100RB#0	21.76	PASS
Band41	20MHz	16QAM	41490	100RB#0	20.90	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



H.2 Peak-to-Average Ratio(CCDF)

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Result(dB)	Limit(dB)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	8.60	13	PASS
Band41	5MHz	16QAM	39675	1RB#0	8.95	13	PASS
Band41	5MHz	QPSK	39675	25RB#0	8.83	13	PASS
Band41	5MHz	16QAM	39675	25RB#0	9.70	13	PASS
Band41	5MHz	QPSK	40620	1RB#0	8.38	13	PASS
Band41	5MHz	16QAM	40620	1RB#0	9.10	13	PASS
Band41	5MHz	QPSK	40620	25RB#0	9.13	13	PASS
Band41	5MHz	16QAM	40620	25RB#0	9.86	13	PASS
Band41	5MHz	QPSK	41565	1RB#0	7.63	13	PASS
Band41	5MHz	16QAM	41565	1RB#0	7.99	13	PASS
Band41	5MHz	QPSK	41565	25RB#0	8.46	13	PASS
Band41	5MHz	16QAM	41565	25RB#0	8.94	13	PASS
Band41	10MHz	QPSK	39700	1RB#0	8.00	13	PASS
Band41	10MHz	16QAM	39700	1RB#0	8.43	13	PASS
Band41	10MHz	QPSK	39700	50RB#0	9.23	13	PASS
Band41	10MHz	16QAM	39700	50RB#0	9.34	13	PASS
Band41	10MHz	QPSK	40620	1RB#0	8.72	13	PASS
Band41	10MHz	16QAM	40620	1RB#0	9.31	13	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.22	13	PASS
Band41	10MHz	16QAM	40620	50RB#0	9.45	13	PASS
Band41	10MHz	QPSK	41540	1RB#0	8.60	13	PASS
Band41	10MHz	16QAM	41540	1RB#0	8.88	13	PASS
Band41	10MHz	QPSK	41540	50RB#0	9.04	13	PASS
Band41	10MHz	16QAM	41540	50RB#0	9.71	13	PASS
Band41	15MHz	QPSK	39725	1RB#0	8.24	13	PASS
Band41	15MHz	16QAM	39725	1RB#0	8.72	13	PASS
Band41	15MHz	QPSK	39725	75RB#0	8.95	13	PASS
Band41	15MHz	16QAM	39725	75RB#0	9.52	13	PASS
Band41	15MHz	QPSK	40620	1RB#0	8.72	13	PASS
Band41	15MHz	16QAM	40620	1RB#0	9.08	13	PASS
Band41	15MHz	QPSK	40620	75RB#0	9.09	13	PASS
Band41	15MHz	16QAM	40620	75RB#0	9.67	13	PASS
Band41	15MHz	QPSK	41515	1RB#0	8.78	13	PASS
Band41	15MHz	16QAM	41515	1RB#0	9.65	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	41515	75RB#0	9.26	13	PASS
Band41	15MHz	16QAM	41515	75RB#0	9.38	13	PASS
Band41	20MHz	QPSK	39750	1RB#0	8.63	13	PASS
Band41	20MHz	16QAM	39750	1RB#0	8.58	13	PASS
Band41	20MHz	QPSK	39750	100RB#0	8.79	13	PASS
Band41	20MHz	16QAM	39750	100RB#0	9.84	13	PASS
Band41	20MHz	QPSK	40620	1RB#0	8.15	13	PASS
Band41	20MHz	16QAM	40620	1RB#0	9.08	13	PASS
Band41	20MHz	QPSK	40620	100RB#0	9.31	13	PASS
Band41	20MHz	16QAM	40620	100RB#0	9.71	13	PASS
Band41	20MHz	QPSK	41490	1RB#0	8.30	13	PASS
Band41	20MHz	16QAM	41490	1RB#0	8.37	13	PASS
Band41	20MHz	QPSK	41490	100RB#0	8.51	13	PASS
Band41	20MHz	16QAM	41490	100RB#0	9.49	13	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

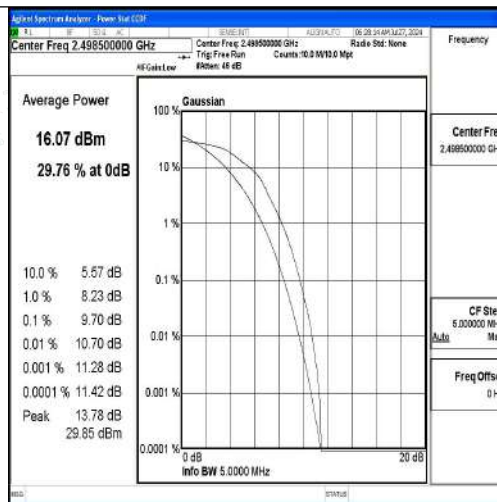

Band41-5MHz-16QAM-39675-25RB#0-PASS

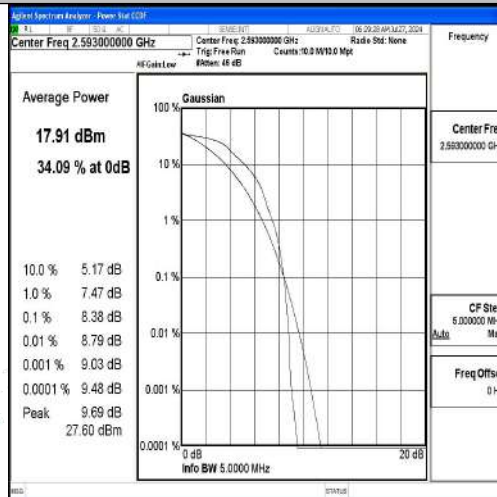

Band41-5MHz-QPSK-40620-1RB#0-PASS

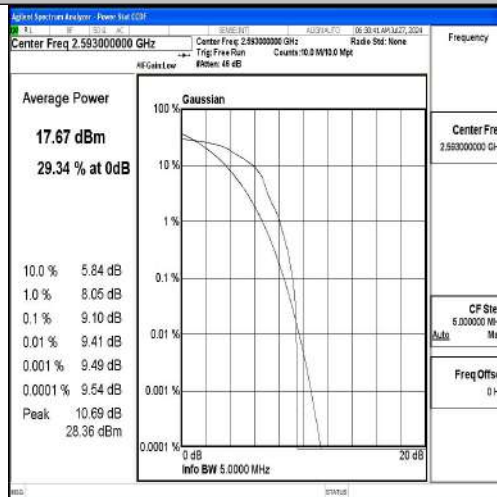

Band41-5MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

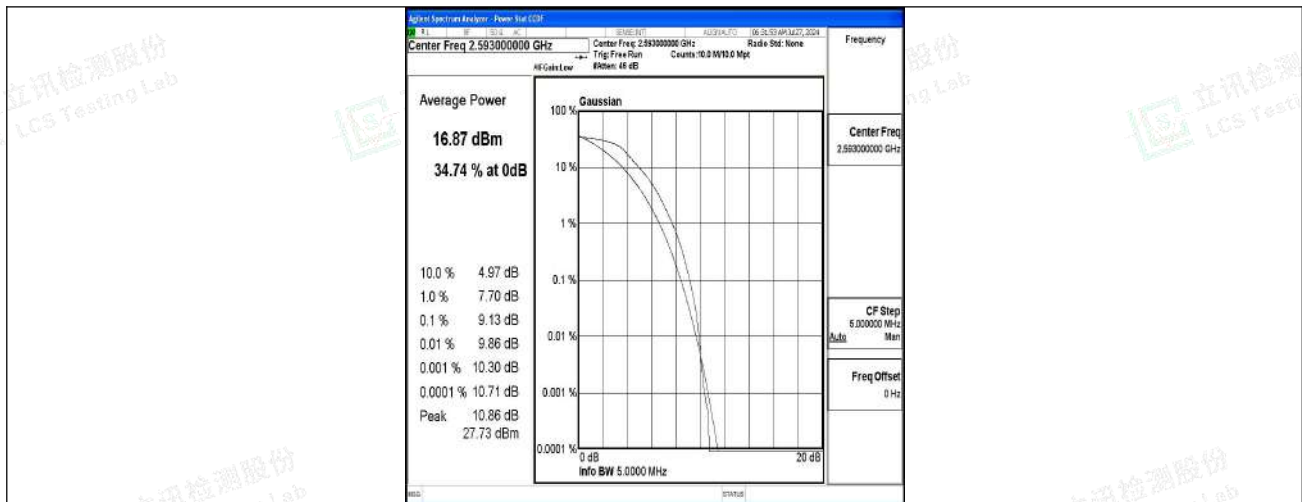

Band41-5MHz-QPSK-40620-25RB#0-PASS

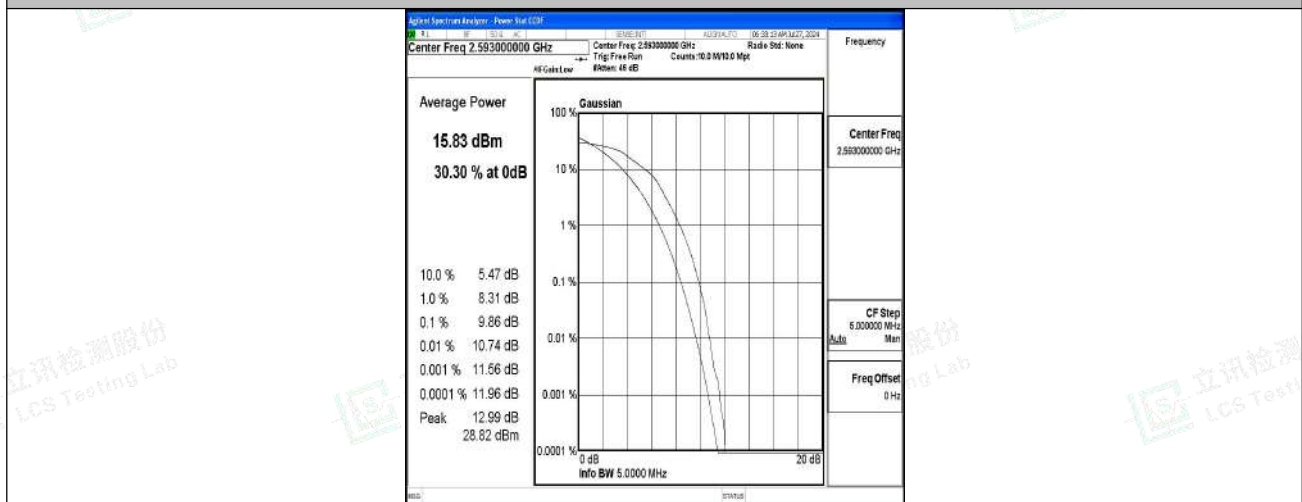

Band41-5MHz-16QAM-40620-25RB#0-PASS

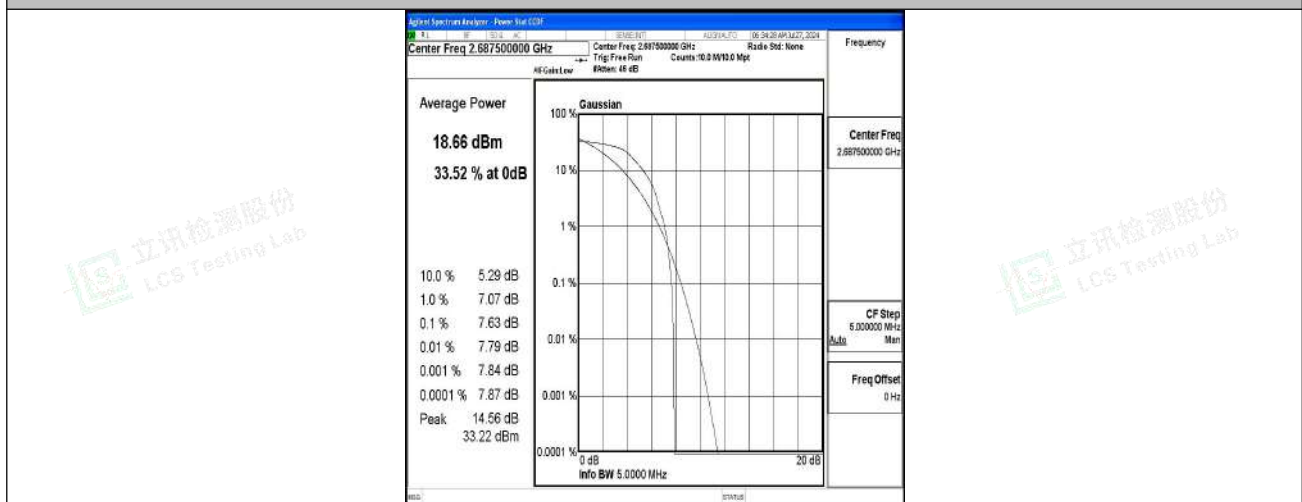

Band41-5MHz-QPSK-41565-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

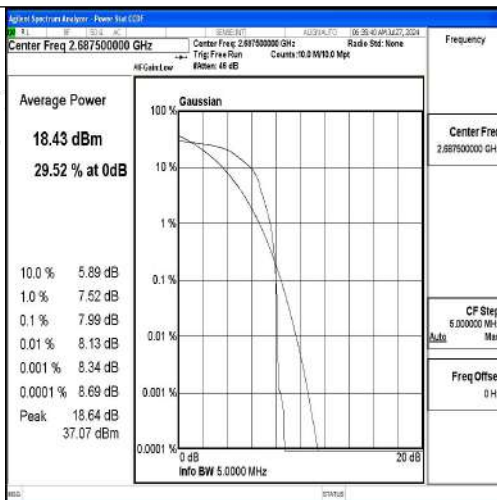

Band41-5MHz-16QAM-41565-1RB#0-PASS

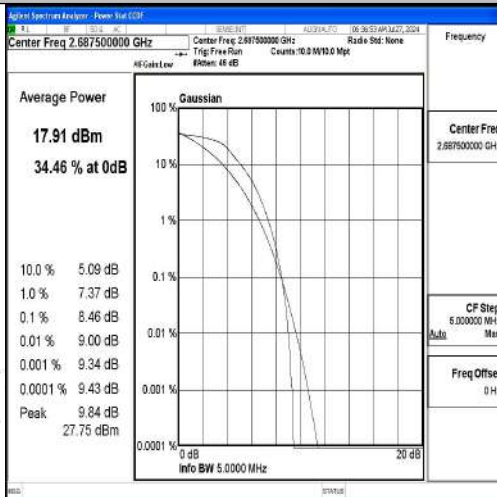

Band41-5MHz-QPSK-41565-25RB#0-PASS

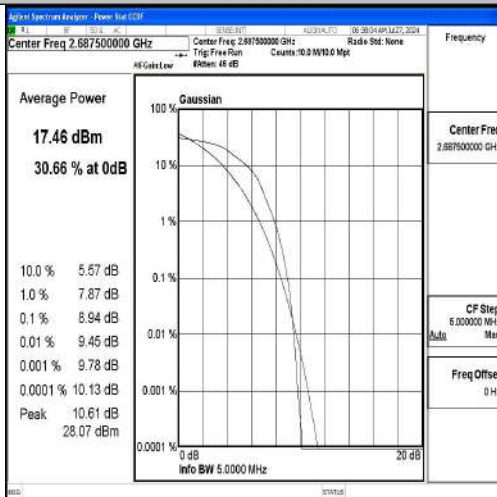

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

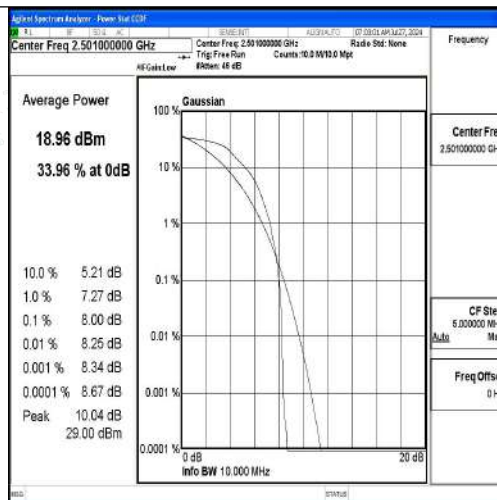

Band41-10MHz-QPSK-39700-1RB#0-PASS

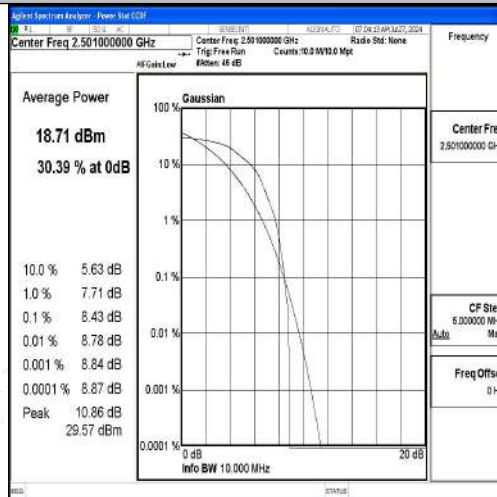

Band41-10MHz-16QAM-39700-1RB#0-PASS

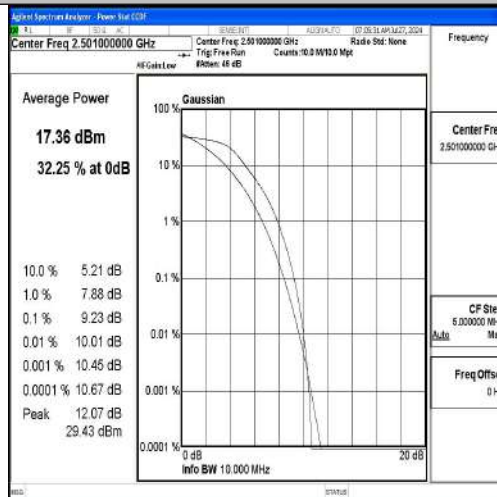

Band41-10MHz-QPSK-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

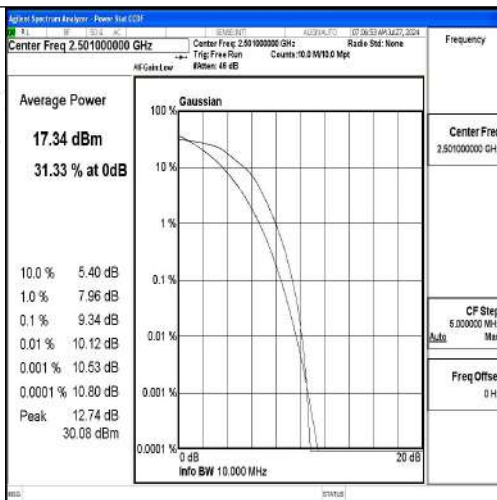

Band41-10MHz-16QAM-39700-50RB#0-PASS

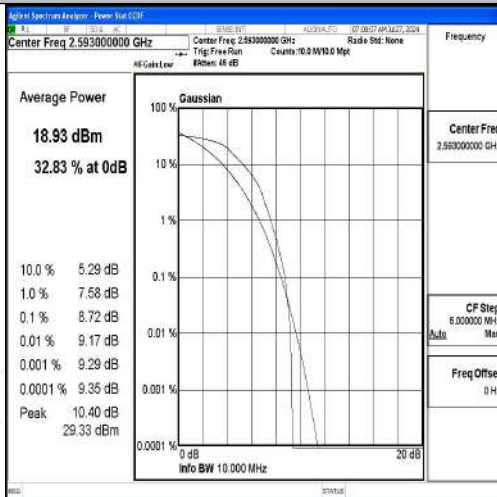

Band41-10MHz-QPSK-40620-1RB#0-PASS

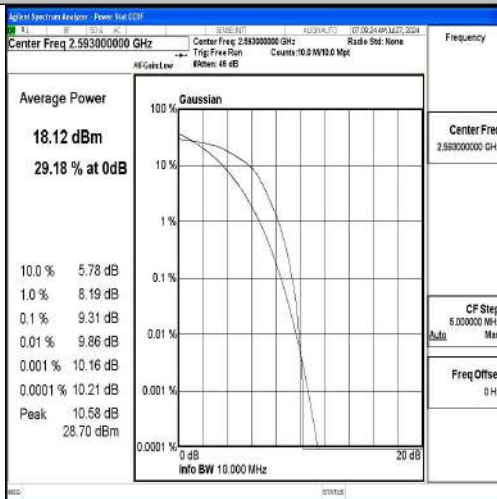

Band41-10MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

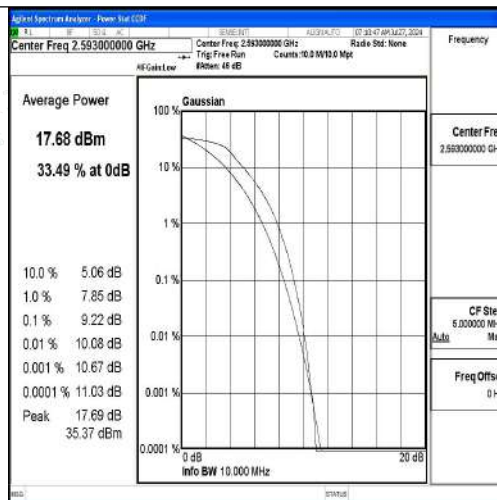

Band41-10MHz-QPSK-40620-50RB#0-PASS

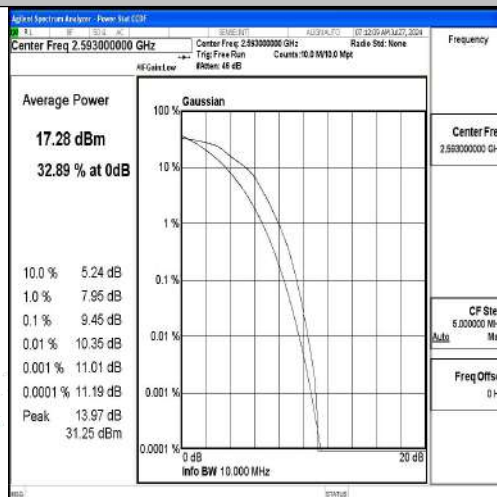

Band41-10MHz-16QAM-40620-50RB#0-PASS

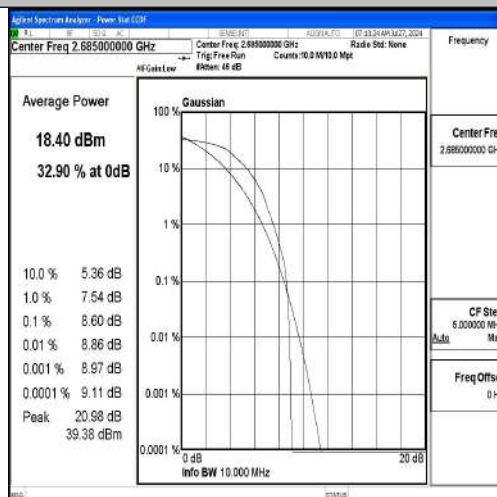

Band41-10MHz-QPSK-41540-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

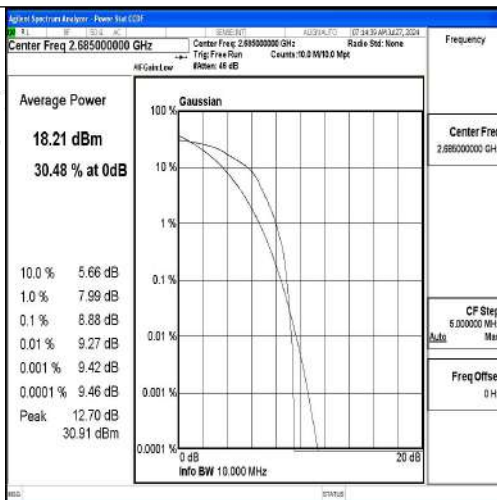

Band41-10MHz-16QAM-41540-1RB#0-PASS

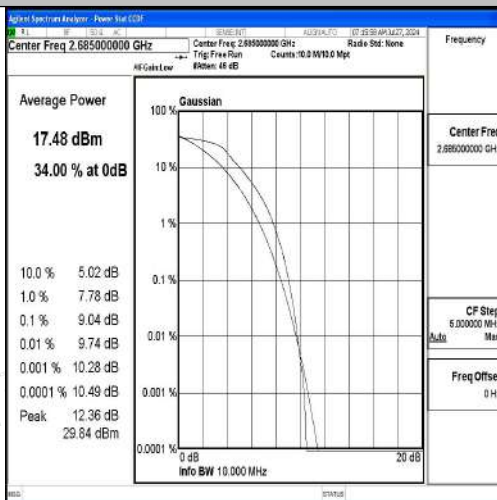

Band41-10MHz-QPSK-41540-50RB#0-PASS

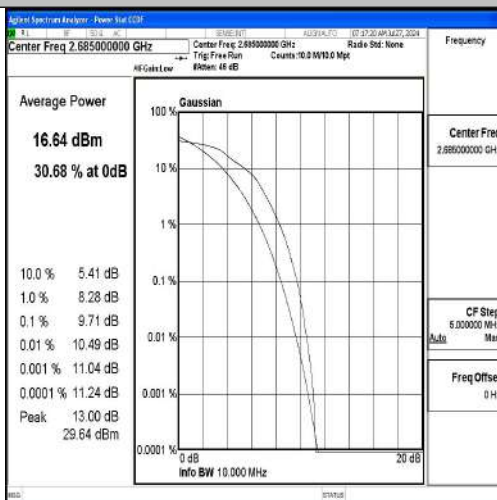

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

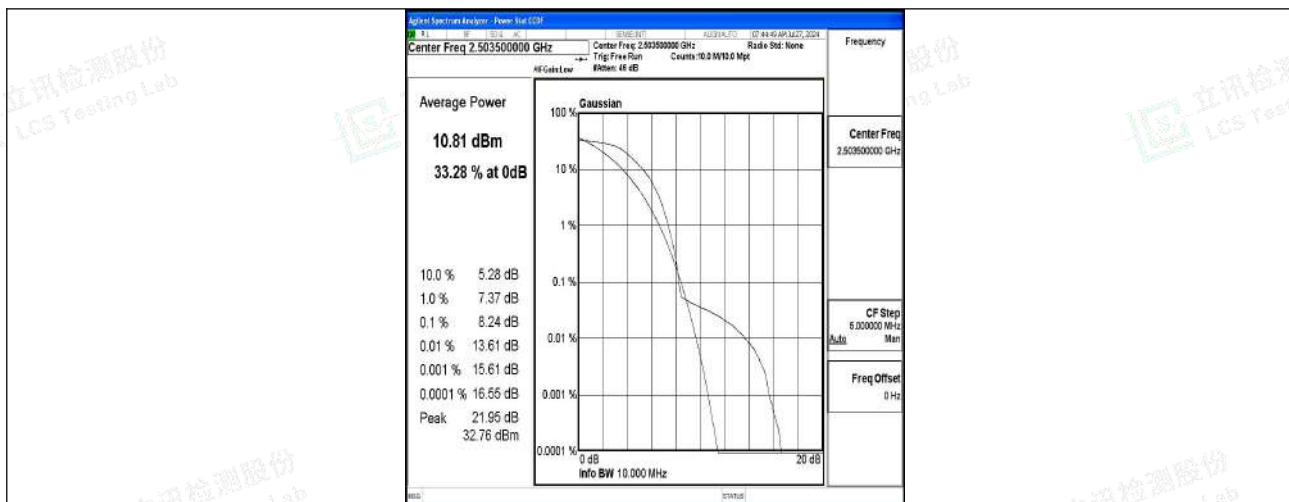

Band41-15MHz-QPSK-39725-1RB#0-PASS

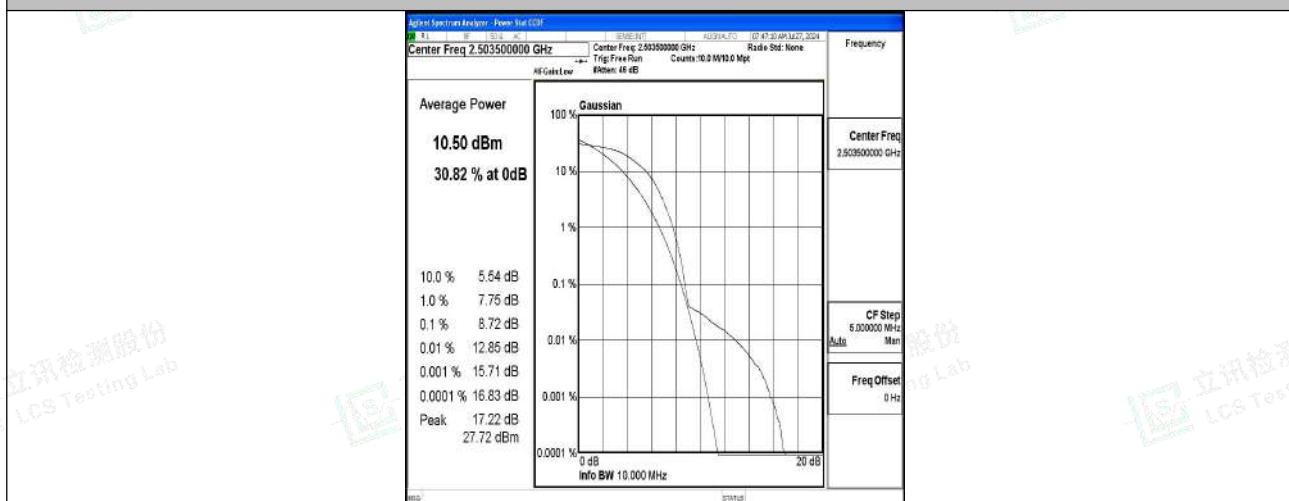

Band41-15MHz-16QAM-39725-1RB#0-PASS

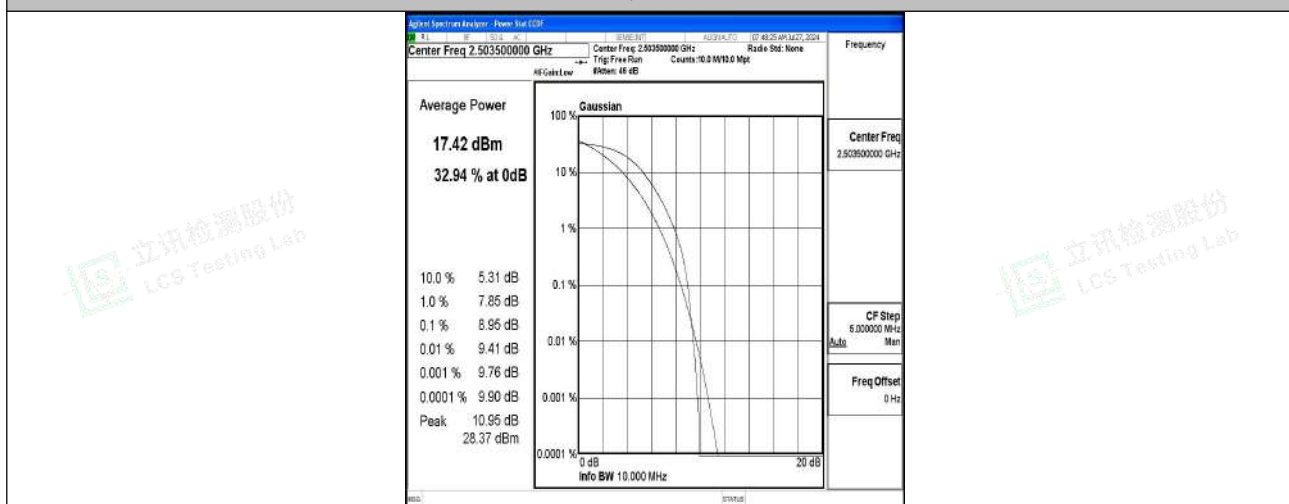

Band41-15MHz-QPSK-39725-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

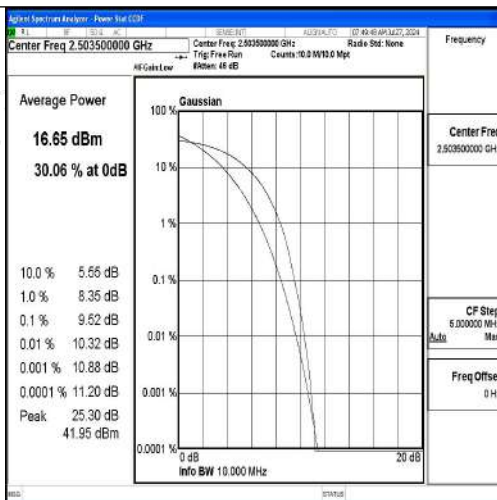

Band41-15MHz-16QAM-39725-75RB#0-PASS

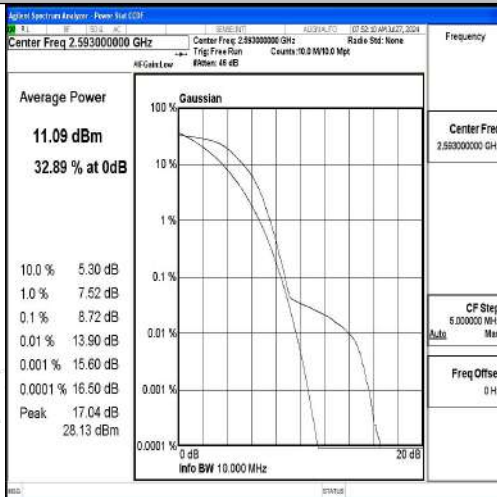

Band41-15MHz-QPSK-40620-1RB#0-PASS

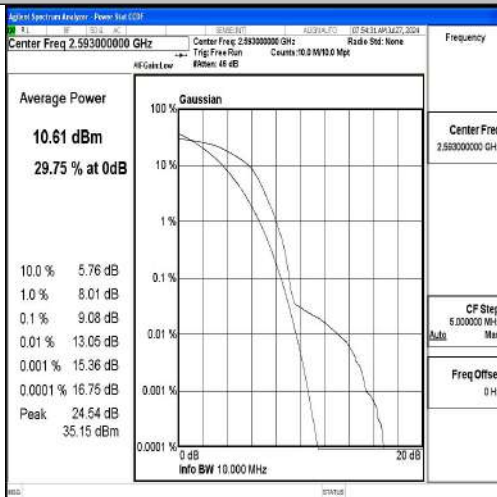

Band41-15MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

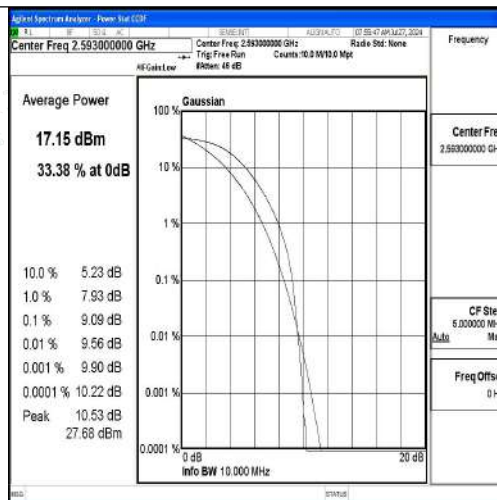

Band41-15MHz-QPSK-40620-75RB#0-PASS

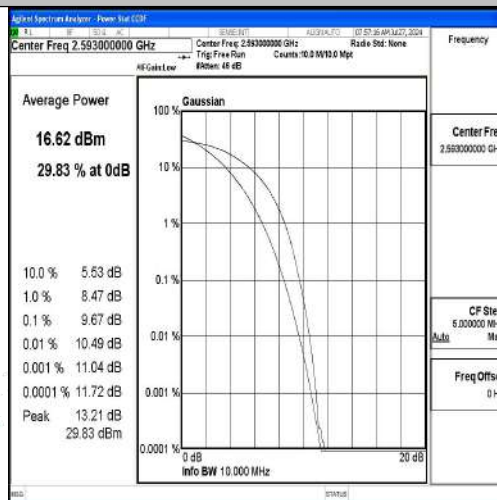

Band41-15MHz-16QAM-40620-75RB#0-PASS

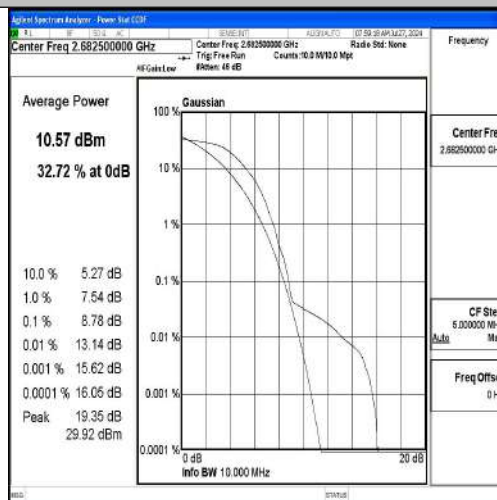

Band41-15MHz-QPSK-41515-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

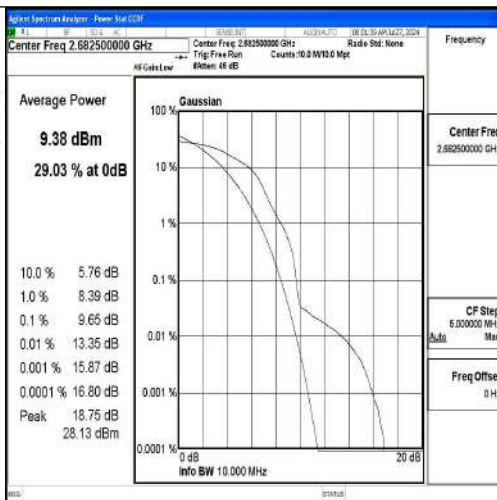

Band41-15MHz-16QAM-41515-1RB#0-PASS

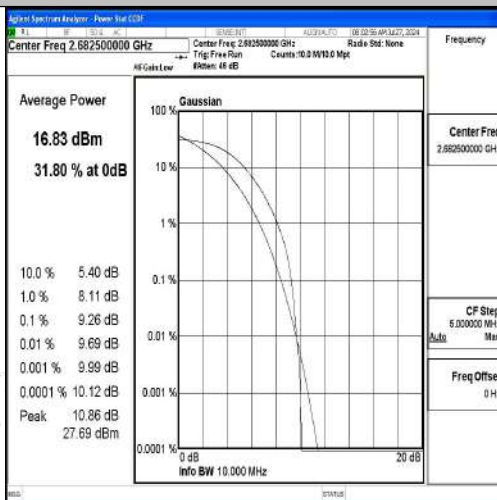

Band41-15MHz-QPSK-41515-75RB#0-PASS

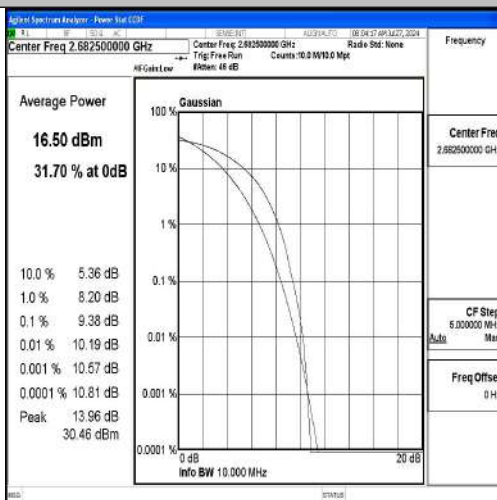

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

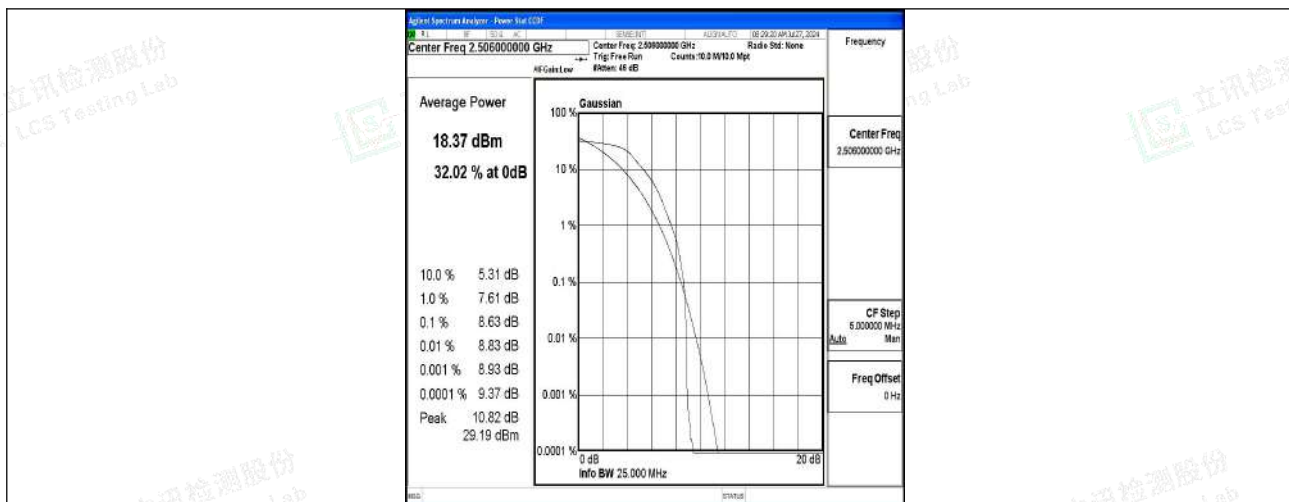

Band41-20MHz-QPSK-39750-1RB#0-PASS

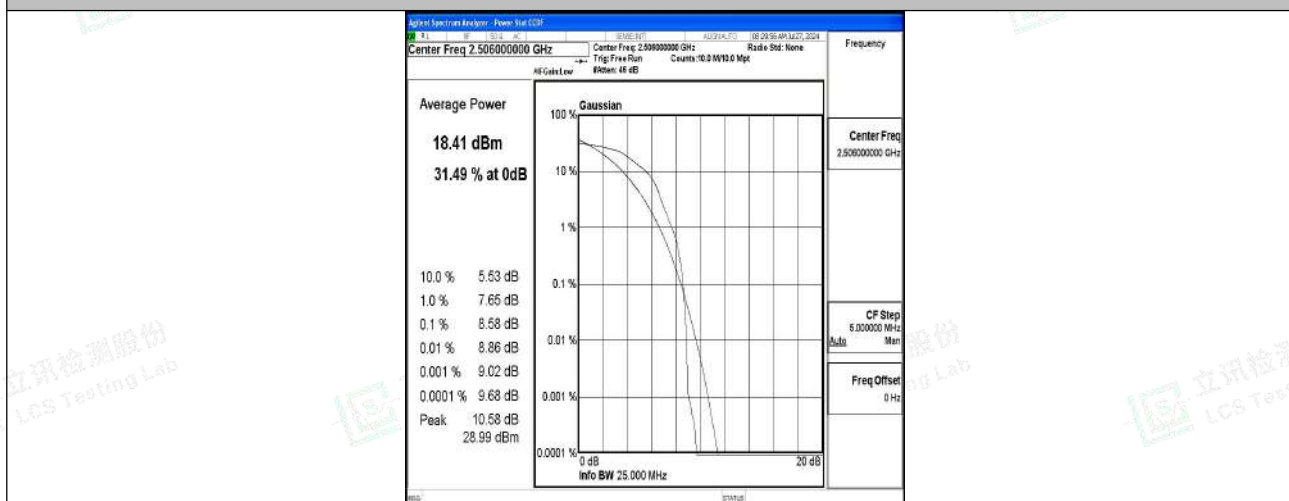

Band41-20MHz-16QAM-39750-1RB#0-PASS

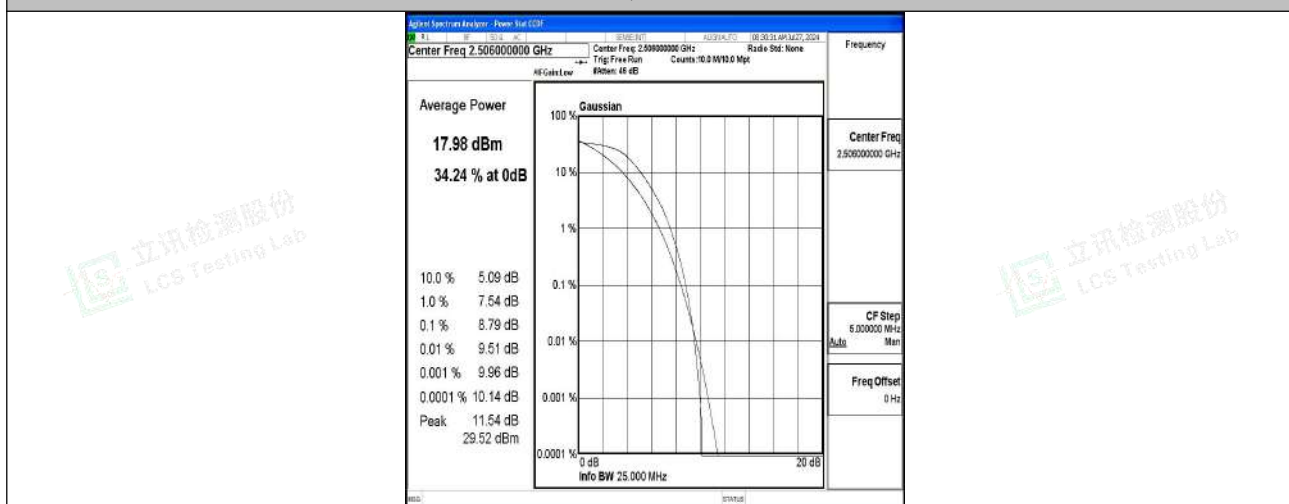

Band41-20MHz-QPSK-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

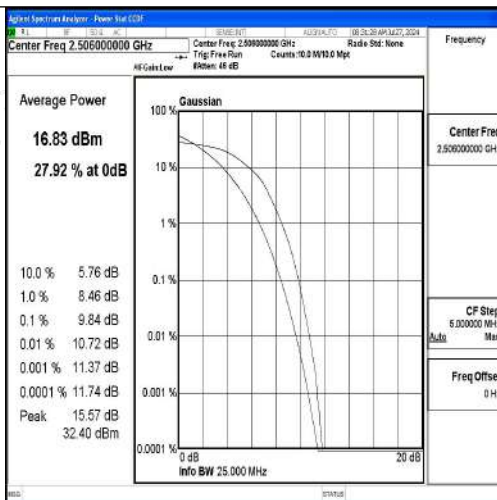

Band41-20MHz-16QAM-39750-100RB#0-PASS

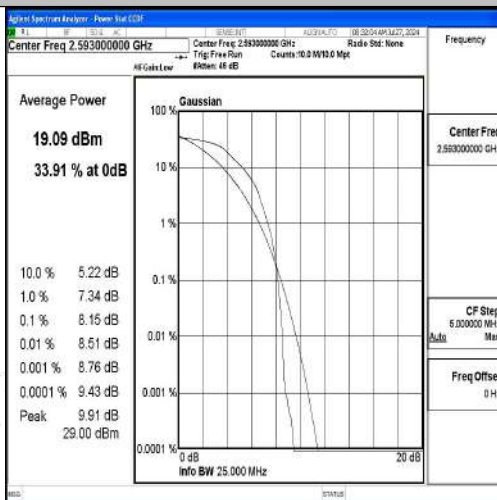

Band41-20MHz-QPSK-40620-1RB#0-PASS

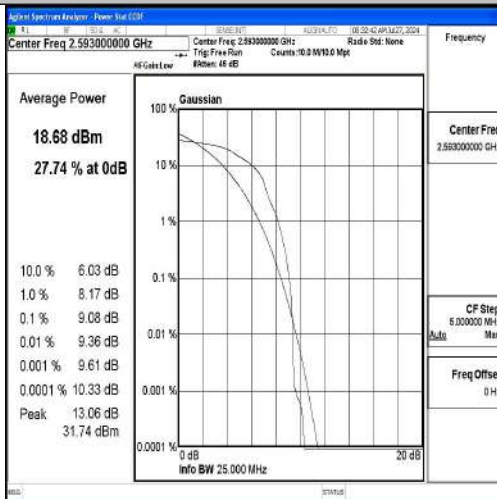

Band41-20MHz-16QAM-40620-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

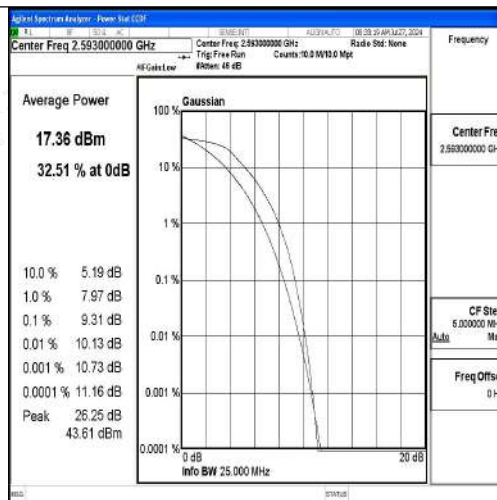

Band41-20MHz-QPSK-40620-100RB#0-PASS

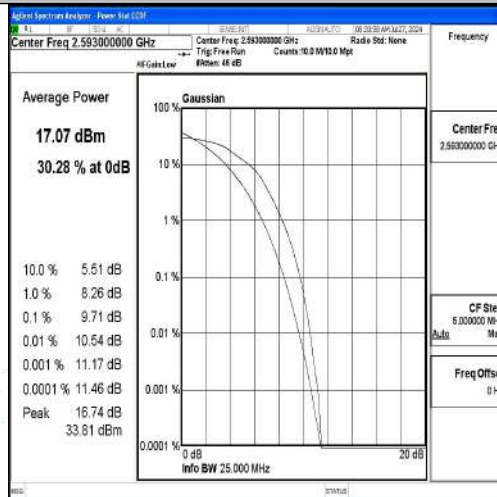

Band41-20MHz-16QAM-40620-100RB#0-PASS

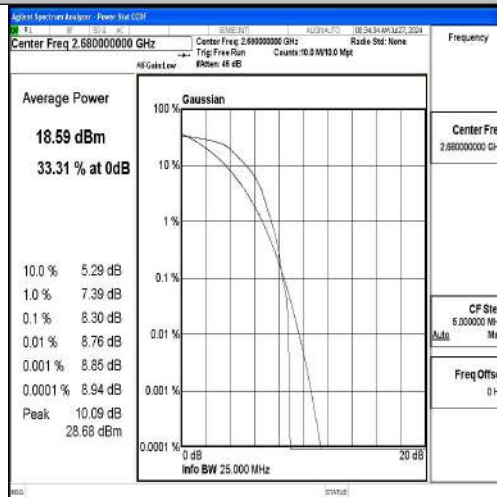

Band41-20MHz-QPSK-41490-1RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

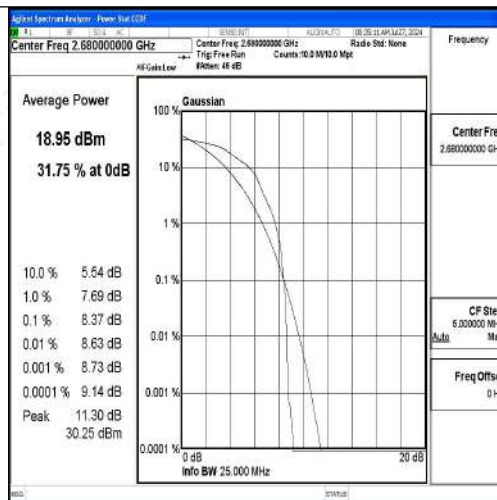

Band41-20MHz-16QAM-41490-1RB#0-PASS

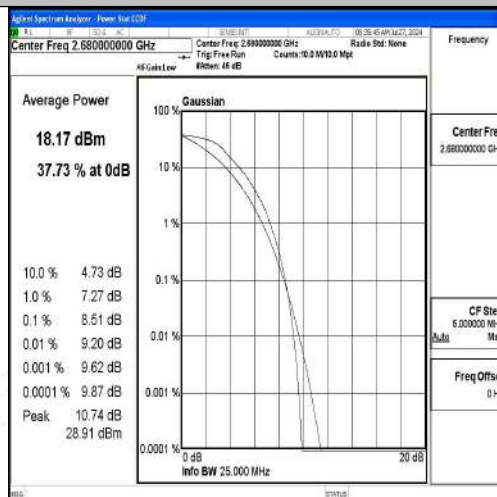

Band41-20MHz-QPSK-41490-100RB#0-PASS

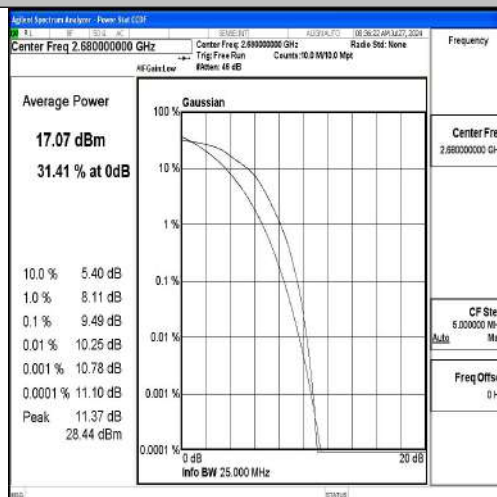

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



H.3 26dB Bandwidth and Occupied Bandwidth

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Occupied Bandwidth (MHz)	26dB Bandwidth (MHz)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	4.5066	5.205	PASS
Band41	5MHz	16QAM	39675	25RB#0	4.5039	5.284	PASS
Band41	5MHz	QPSK	40620	25RB#0	4.5215	5.279	PASS
Band41	5MHz	16QAM	40620	25RB#0	4.5223	5.421	PASS
Band41	5MHz	QPSK	41565	25RB#0	4.4965	5.182	PASS
Band41	5MHz	16QAM	41565	25RB#0	4.5035	5.268	PASS
Band41	10MHz	QPSK	39700	50RB#0	8.9997	10.11	PASS
Band41	10MHz	16QAM	39700	50RB#0	8.9949	10.10	PASS
Band41	10MHz	QPSK	40620	50RB#0	9.0136	10.26	PASS
Band41	10MHz	16QAM	40620	50RB#0	8.9983	11.19	PASS
Band41	10MHz	QPSK	41540	50RB#0	8.9920	10.16	PASS
Band41	10MHz	16QAM	41540	50RB#0	8.9769	9.937	PASS
Band41	15MHz	QPSK	39725	75RB#0	13.539	15.54	PASS
Band41	15MHz	16QAM	39725	75RB#0	13.488	15.41	PASS
Band41	15MHz	QPSK	40620	75RB#0	13.480	15.21	PASS
Band41	15MHz	16QAM	40620	75RB#0	13.554	15.99	PASS
Band41	15MHz	QPSK	41515	75RB#0	13.455	15.27	PASS
Band41	15MHz	16QAM	41515	75RB#0	13.499	15.36	PASS
Band41	20MHz	QPSK	39750	100RB#0	17.987	20.18	PASS
Band41	20MHz	16QAM	39750	100RB#0	18.013	20.41	PASS
Band41	20MHz	QPSK	40620	100RB#0	18.023	20.79	PASS
Band41	20MHz	16QAM	40620	100RB#0	17.978	20.14	PASS
Band41	20MHz	QPSK	41490	100RB#0	17.962	19.92	PASS
Band41	20MHz	16QAM	41490	100RB#0	17.970	20.49	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

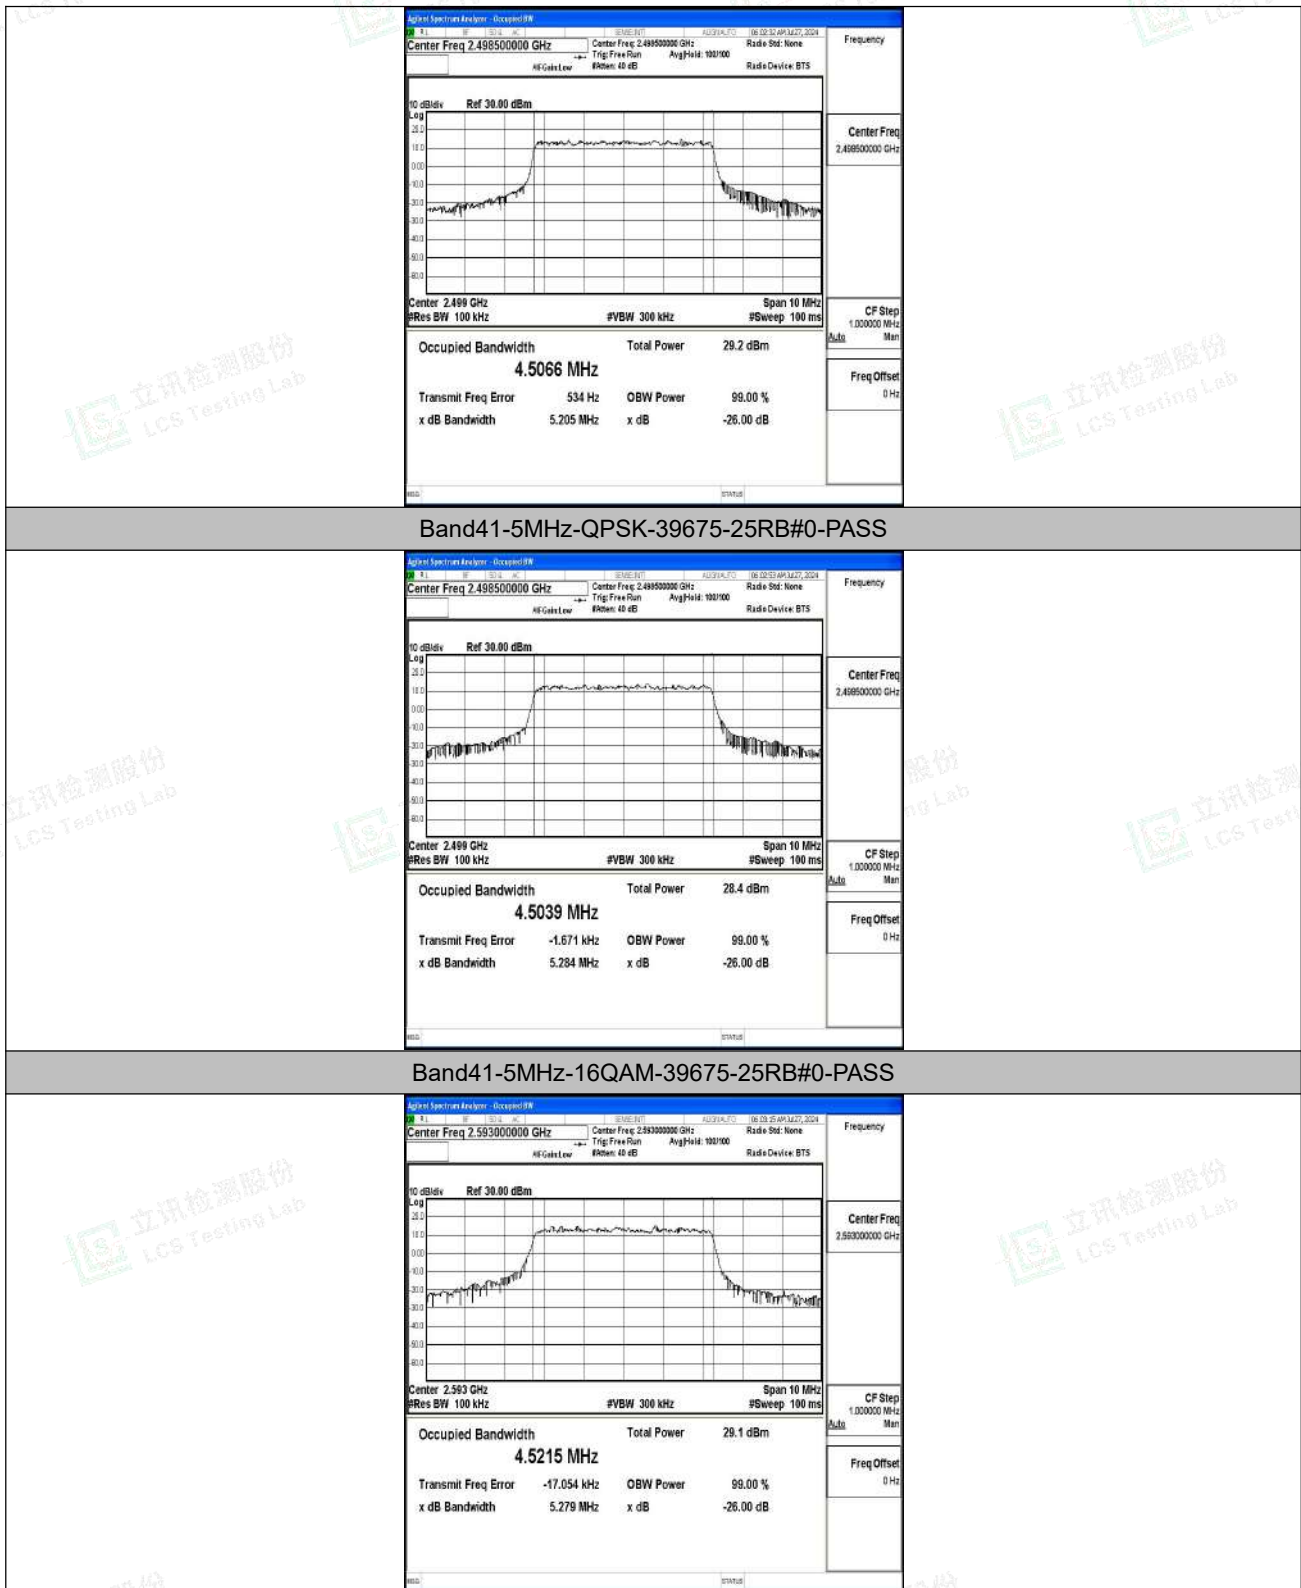

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41-5MHz-QPSK-40620-25RB#0-PASS

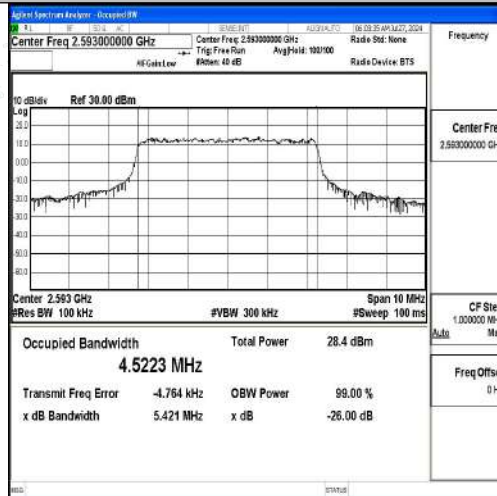

Band41-5MHz-16QAM-40620-25RB#0-PASS

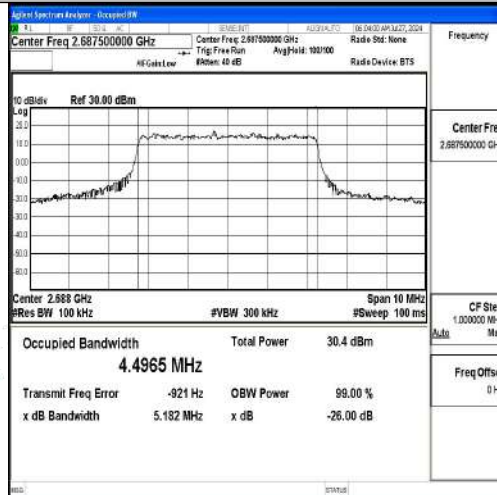

Band41-5MHz-QPSK-41565-25RB#0-PASS

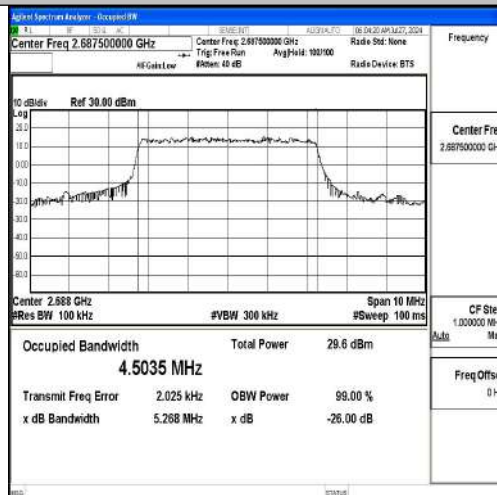

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

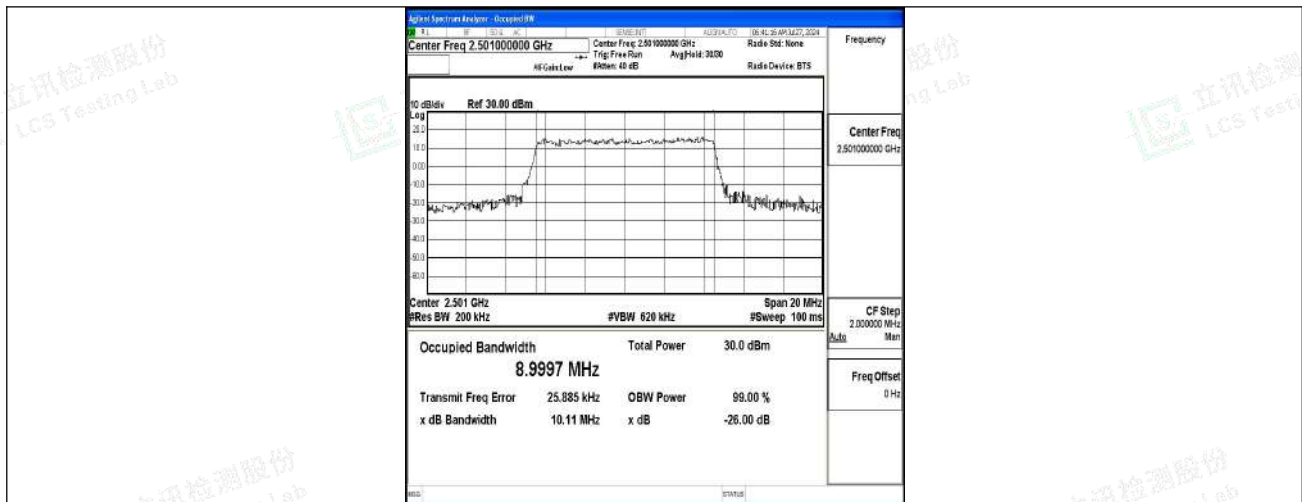

Band41-10MHz-QPSK-39700-50RB#0-PASS

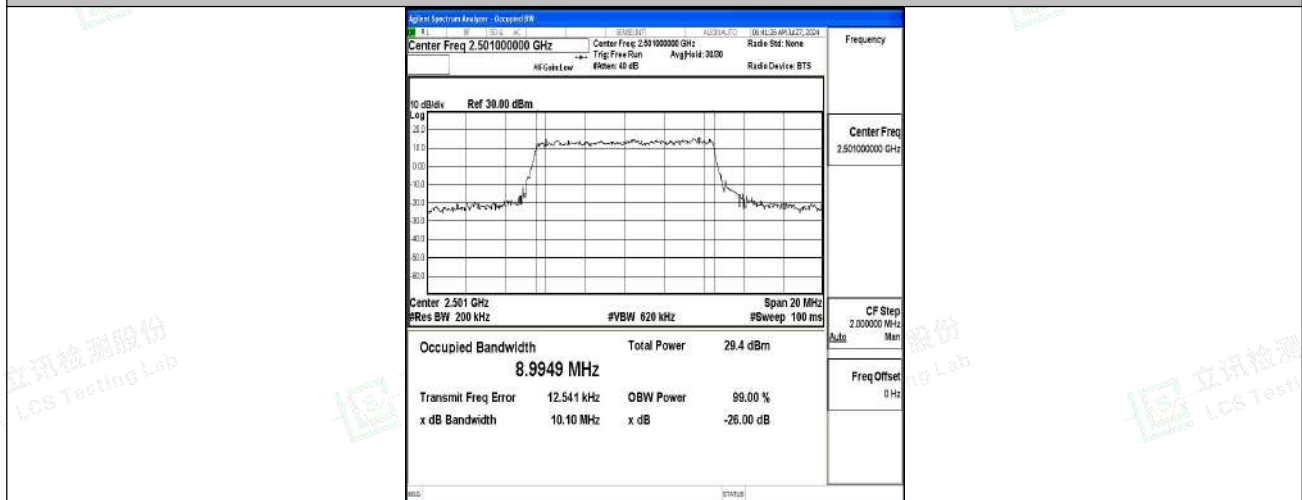

Band41-10MHz-16QAM-39700-50RB#0-PASS

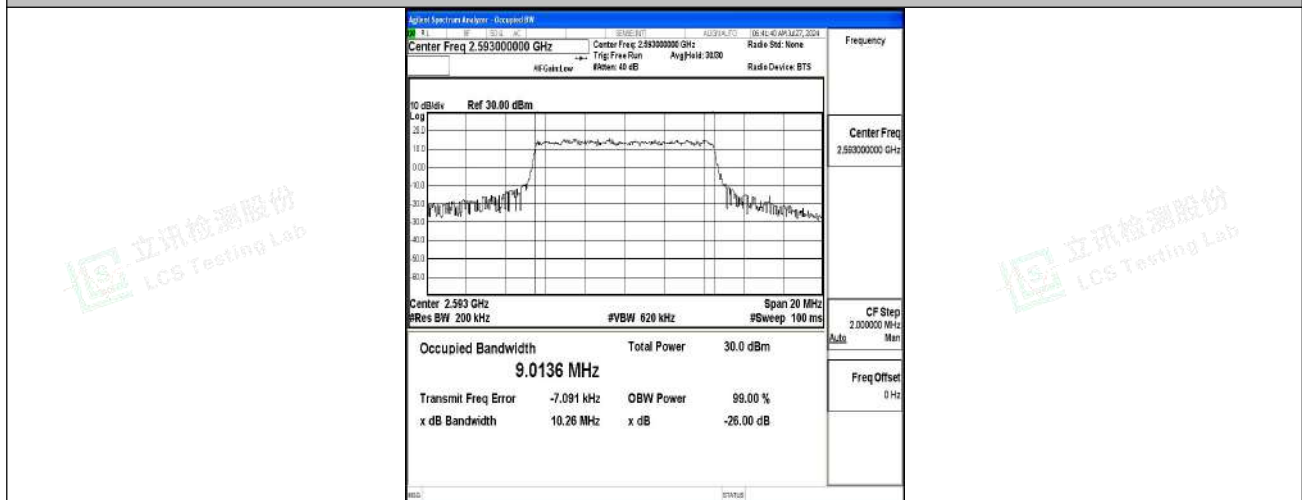

Band41-10MHz-QPSK-40620-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

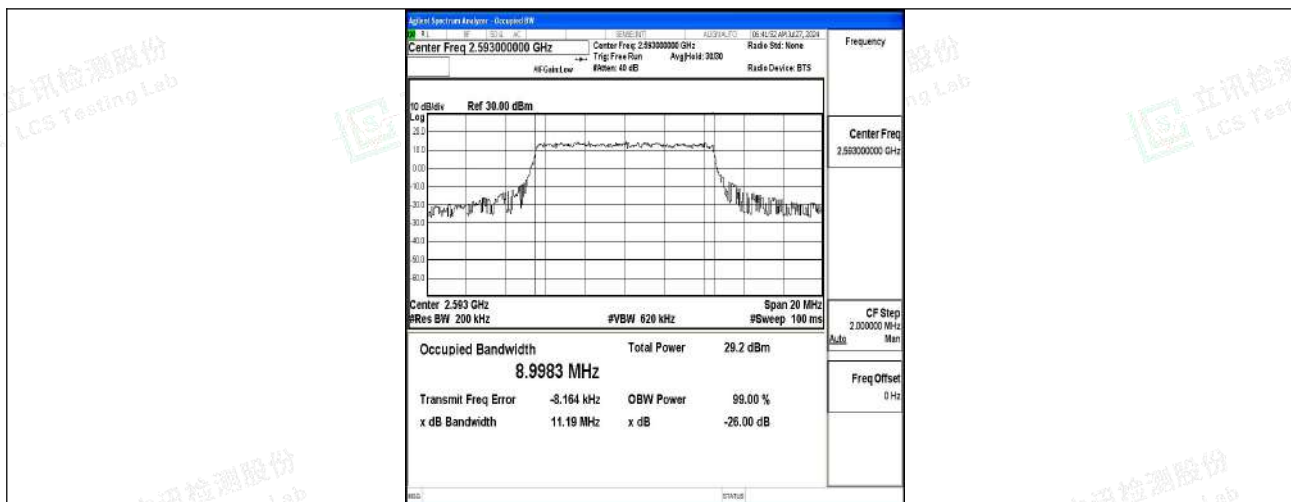

Band41-10MHz-16QAM-40620-50RB#0-PASS

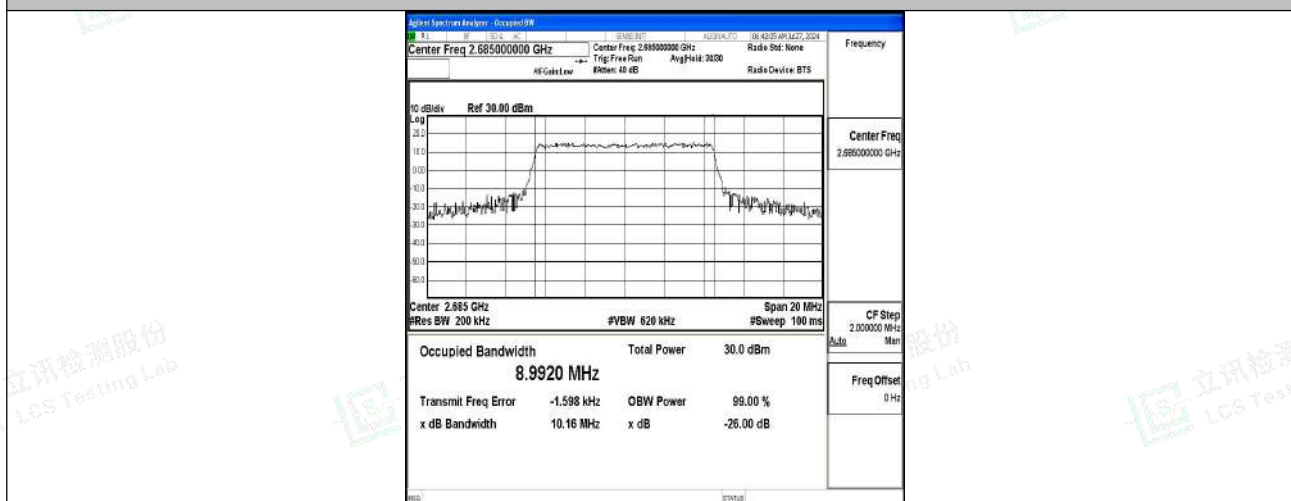

Band41-10MHz-QPSK-41540-50RB#0-PASS

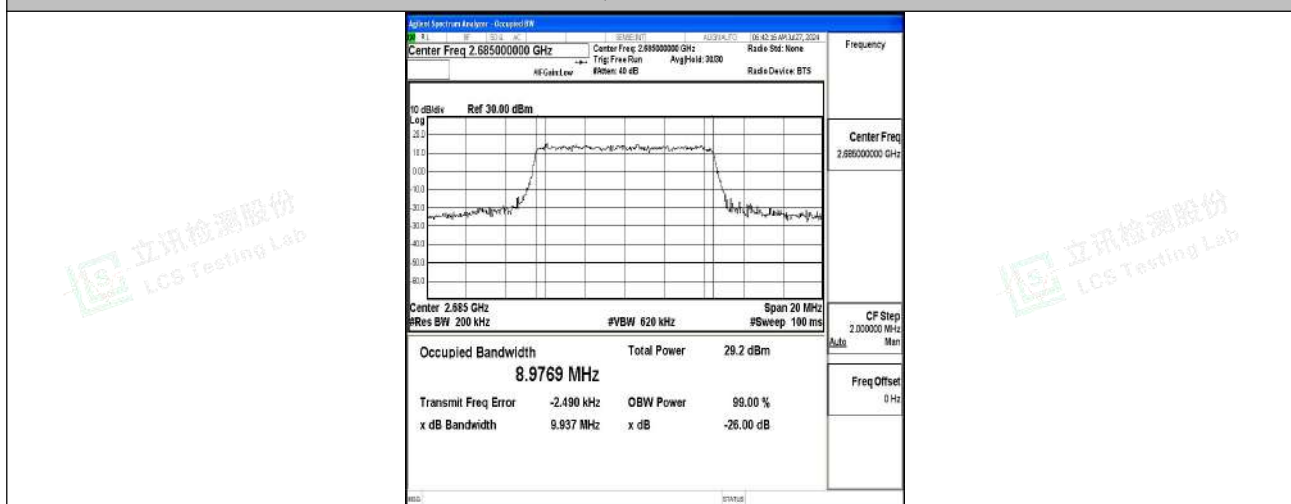

Band41-10MHz-16QAM-41540-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

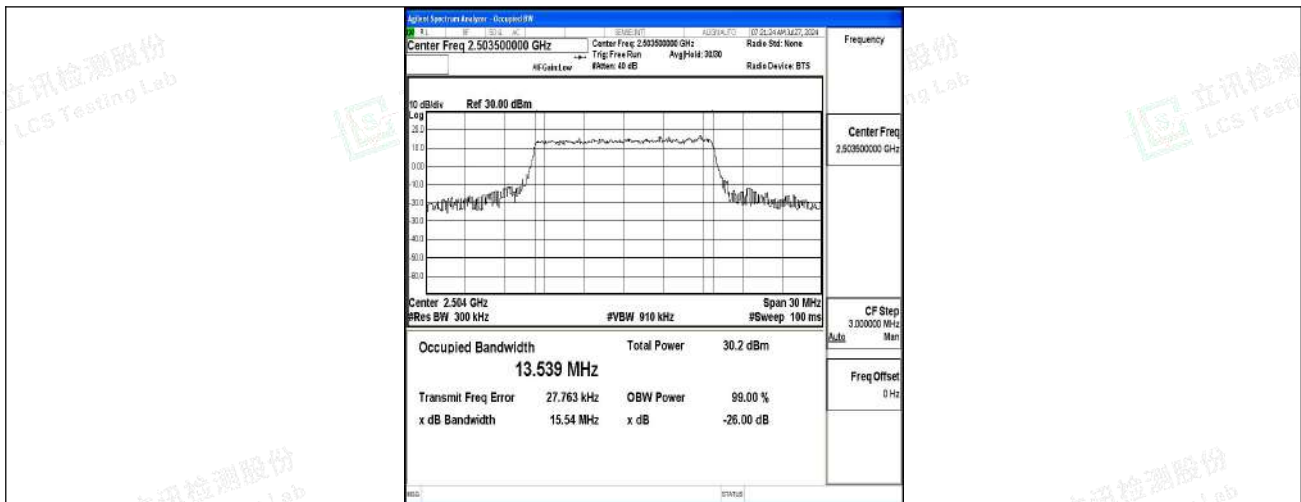

Band41-15MHz-QPSK-39725-75RB#0-PASS

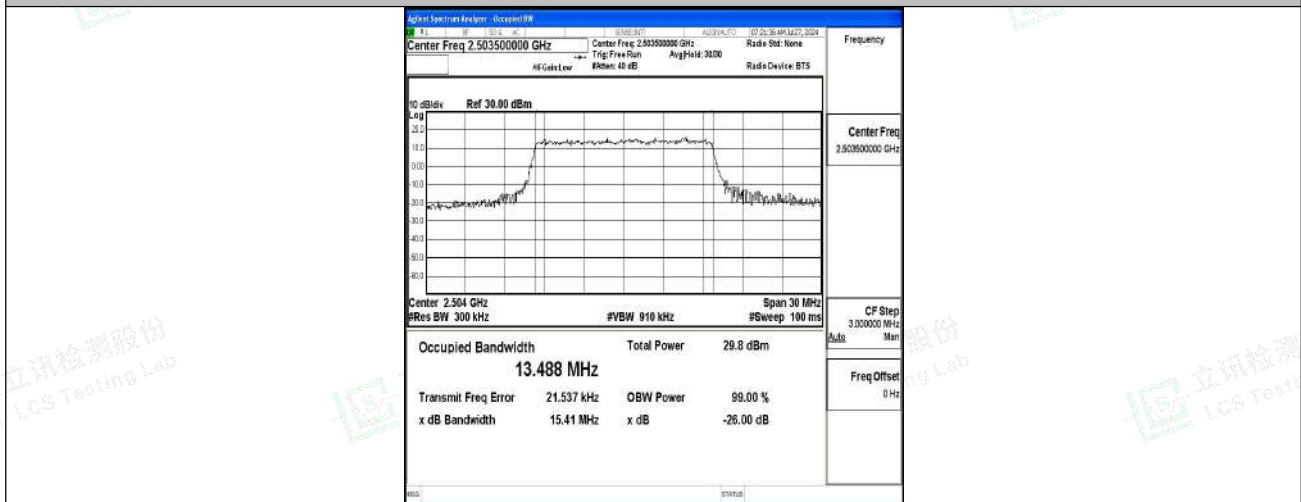

Band41-15MHz-16QAM-39725-75RB#0-PASS

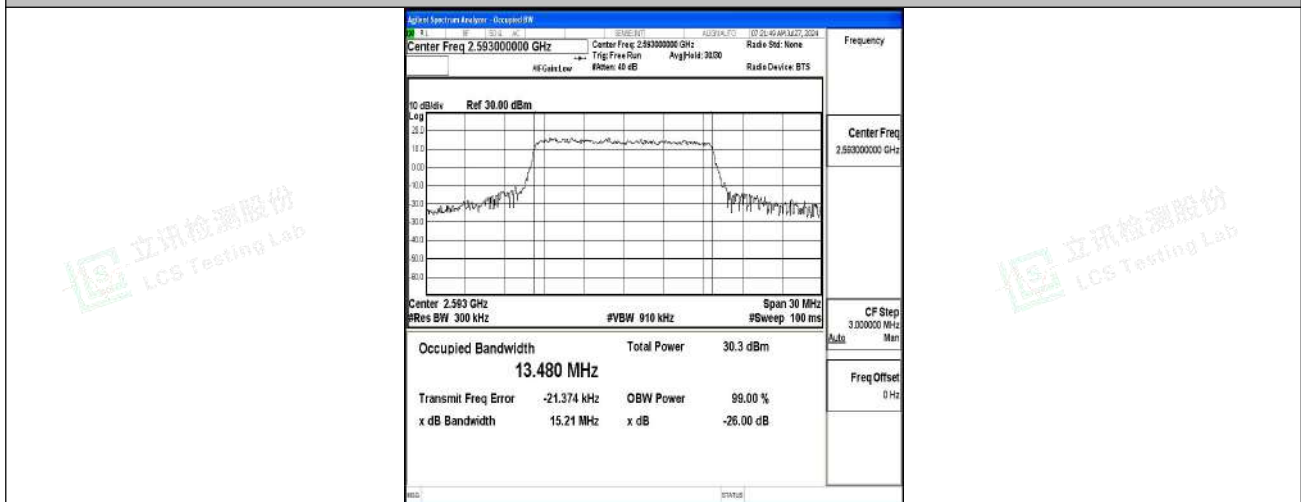

Band41-15MHz-QPSK-40620-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

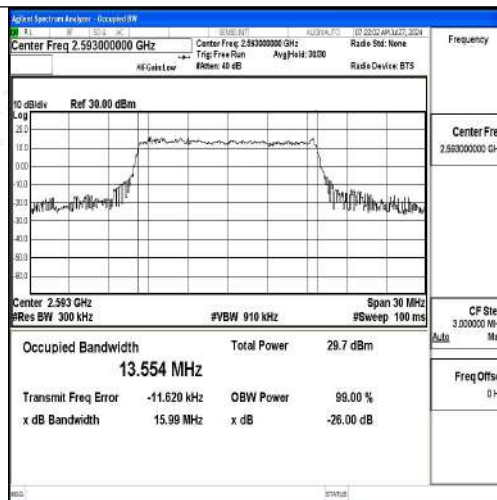

Band41-15MHz-16QAM-40620-75RB#0-PASS

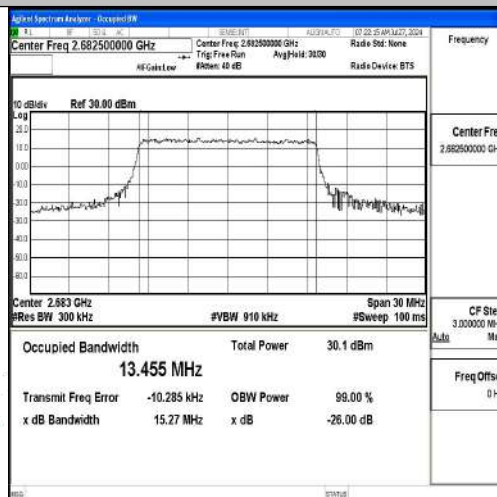

Band41-15MHz-QPSK-41515-75RB#0-PASS

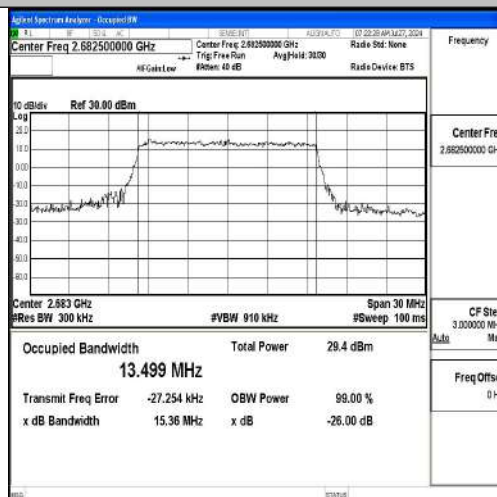

Band41-15MHz-16QAM-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

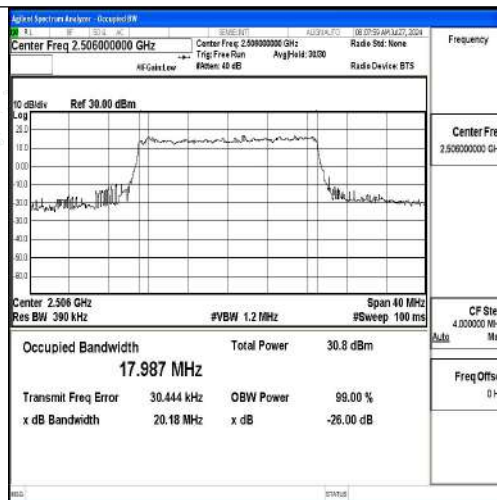

Band41-20MHz-QPSK-39750-100RB#0-PASS

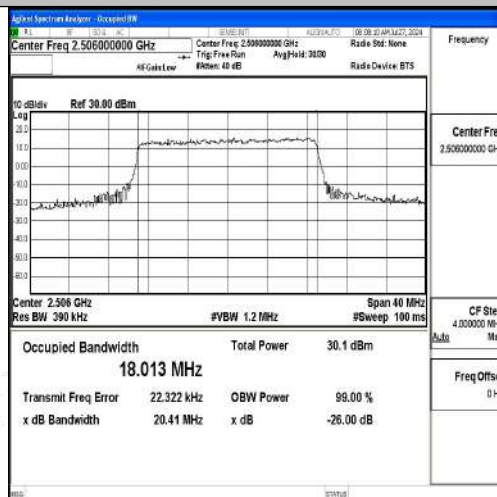

Band41-20MHz-16QAM-39750-100RB#0-PASS

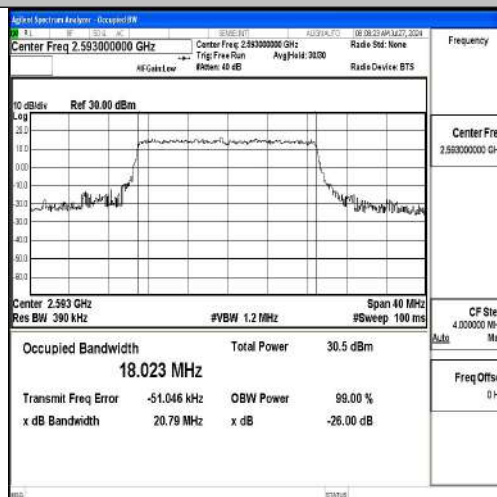

Band41-20MHz-QPSK-40620-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

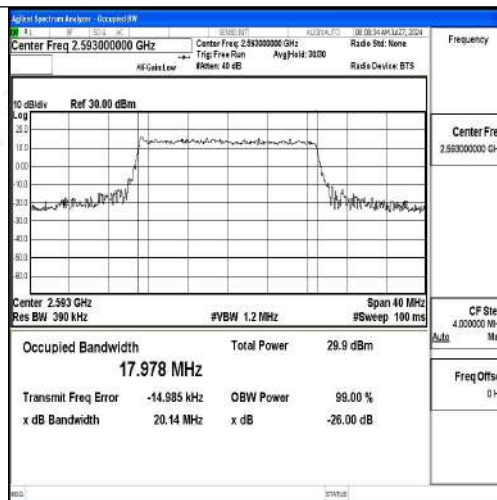

Band41-20MHz-16QAM-40620-100RB#0-PASS

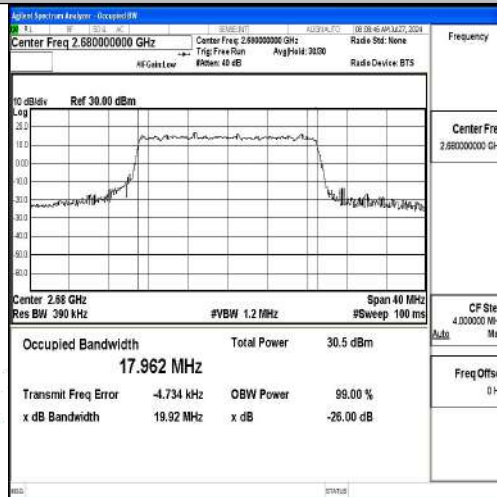

Band41-20MHz-QPSK-41490-100RB#0-PASS

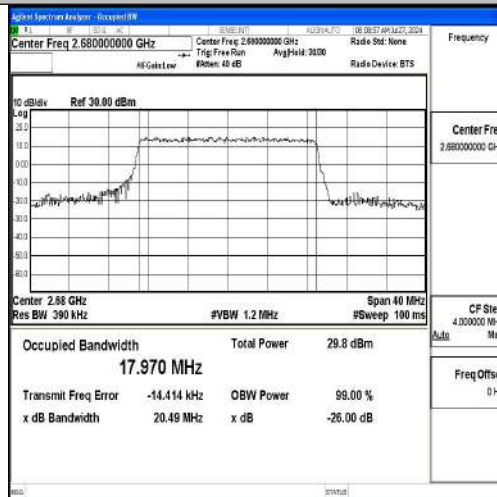

Band41-20MHz-16QAM-41490-100RB#0-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




H.4 Band Edge

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Peak Frequency	Result(dBm)	Verdict
Band41	5MHz	QPSK	39675	25RB#0	2490.39	-43.83	PASS
Band41	5MHz	16QAM	39675	25RB#0	2490.39	-43.49	PASS
Band41	5MHz	QPSK	41565	25RB#0	2696.55	-40.68	PASS
Band41	5MHz	16QAM	41565	25RB#0	2696.04	-40.95	PASS
Band41	10MHz	QPSK	39700	50RB#0	2490.00	-26.06	PASS_Final1
Band41	10MHz	QPSK	39700	50RB#0	2490.38	-36.35	PASS
Band41	10MHz	16QAM	39700	50RB#0	2490.47	-37.31	PASS
Band41	10MHz	QPSK	41540	50RB#0	2700.08	-42.97	PASS
Band41	10MHz	16QAM	41540	50RB#0	2700.38	-43.89	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.43	-25.82	PASS_Final1
Band41	15MHz	QPSK	39725	75RB#0	2489.38	-35.82	PASS
Band41	15MHz	16QAM	39725	75RB#0	2489.52	-35.70	PASS
Band41	20MHz	QPSK	39750	100RB#0	2489.34	-36.96	PASS
Band41	20MHz	16QAM	39750	100RB#0	2489.60	-36.65	PASS
Band41	20MHz	QPSK	41490	100RB#0	2710.01	-43.76	PASS
Band41	20MHz	16QAM	41490	100RB#0	2710.14	-44.94	PASS
Band41	15MHz	QPSK	41515	75RB#0	2705.31	-43.46	PASS
Band41	15MHz	16QAM	41515	75RB#0	2705.87	-42.74	PASS
Band41	15MHz	QPSK	39725	75RB#0	2489.47	-25.96	PASS_Final1

Test Graphs

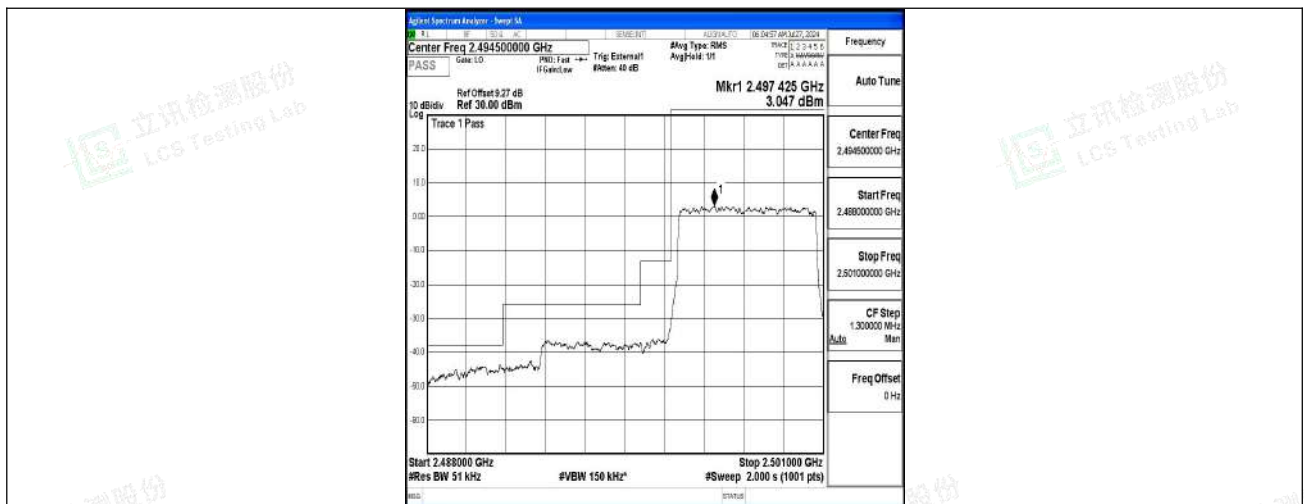

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity




Band41-5MHz-QPSK-39675-25RB#0-PASS

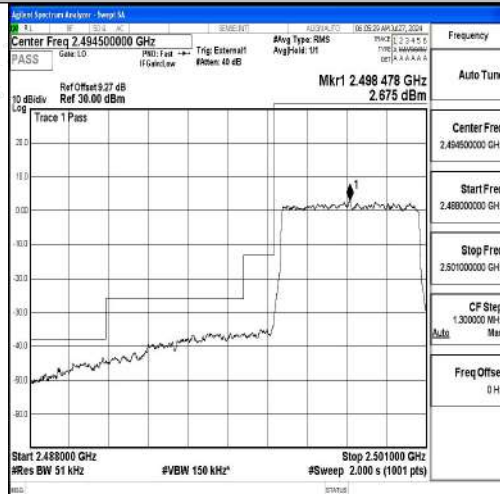

Band41-5MHz-16QAM-39675-25RB#0-PASS

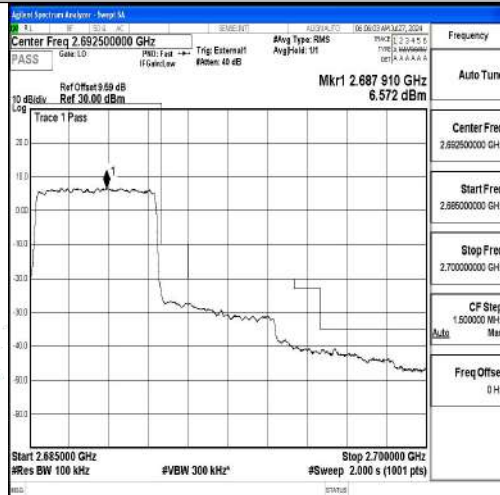

Band41-5MHz-QPSK-41565-25RB#0-PASS

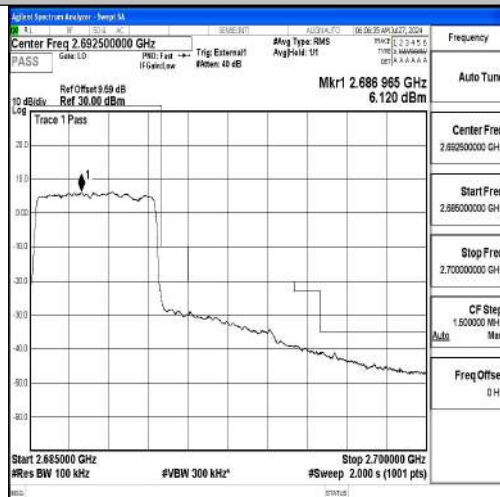

Band41-5MHz-16QAM-41565-25RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

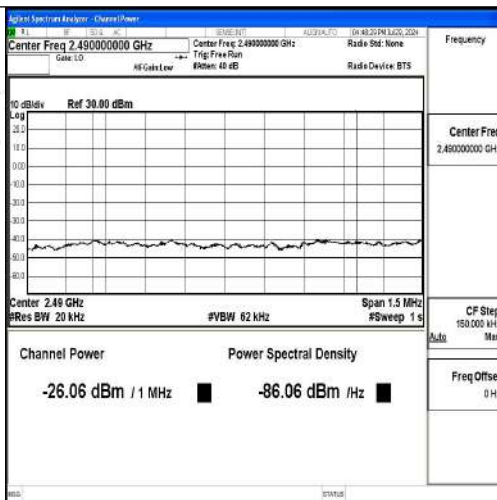

Band41-10MHz-QPSK-39700-50RB#0-PASS_Final1

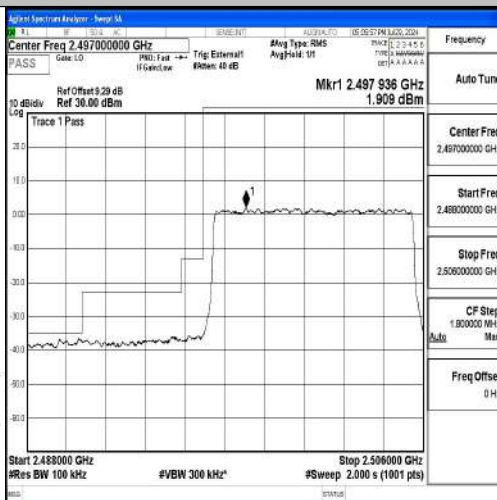

Band41-10MHz-QPSK-39700-50RB#0-PASS

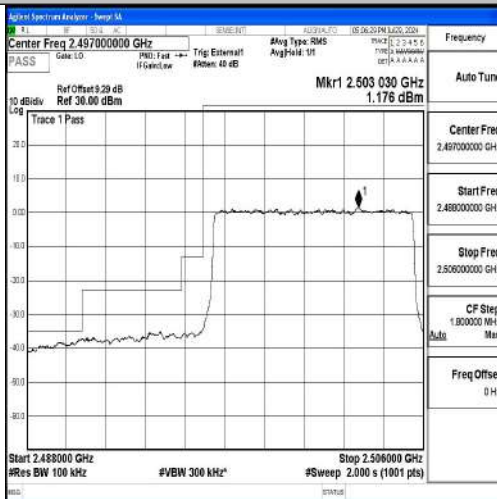

Band41-10MHz-16QAM-39700-50RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

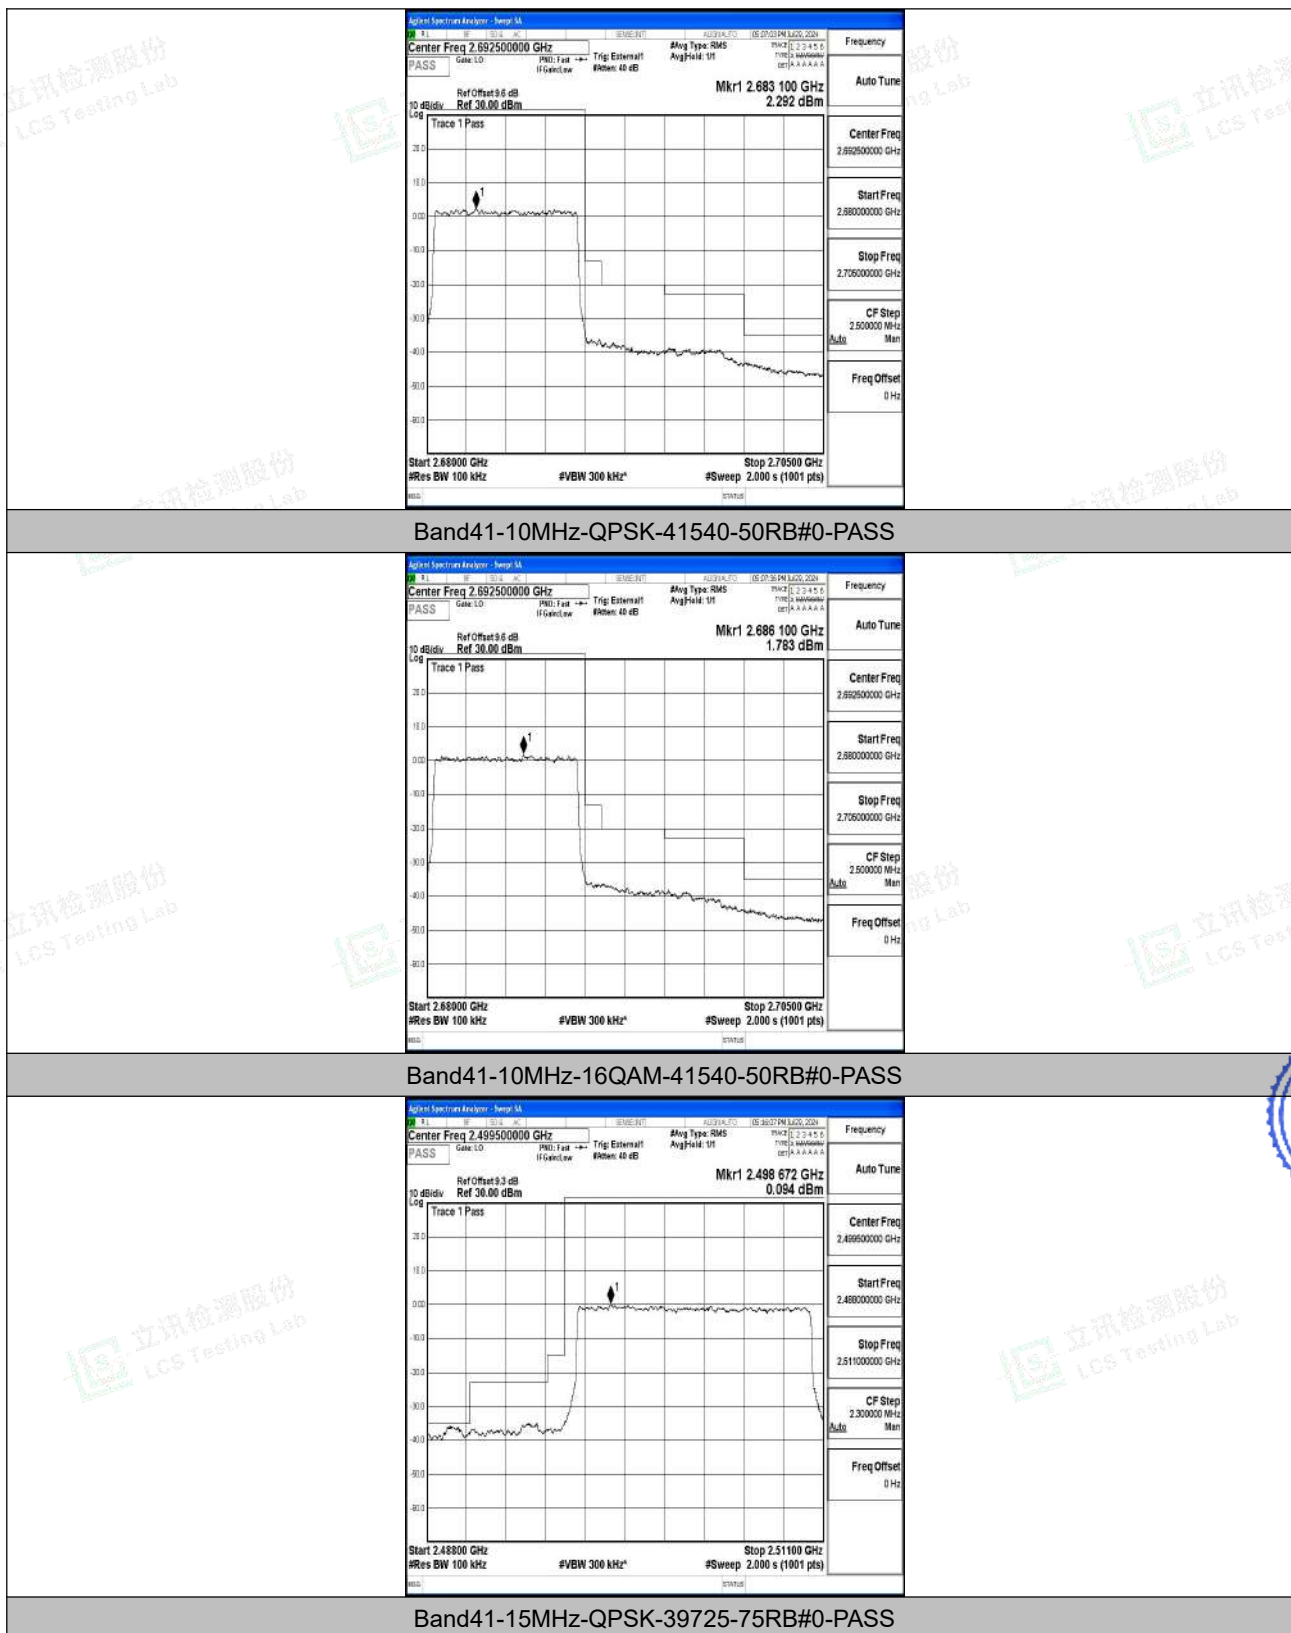


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

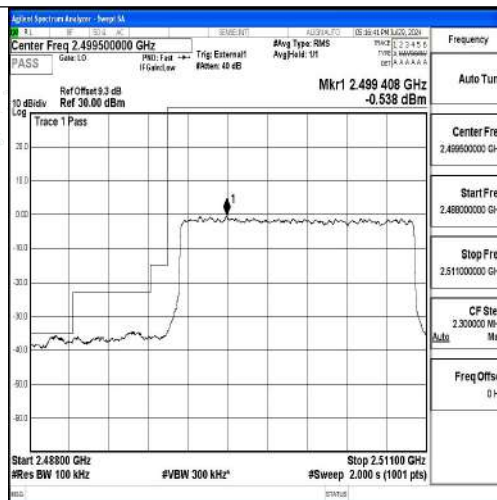

Band41-15MHz-16QAM-39725-75RB#0-PASS

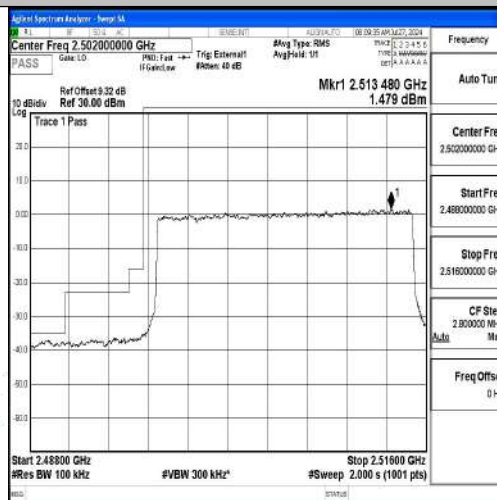

Band41-20MHz-QPSK-39750-100RB#0-PASS

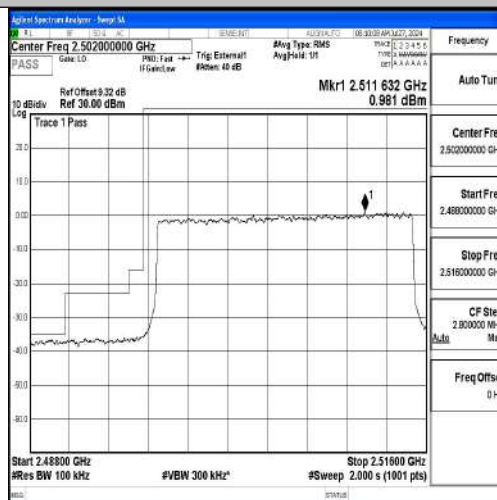

Band41-20MHz-16QAM-39750-100RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

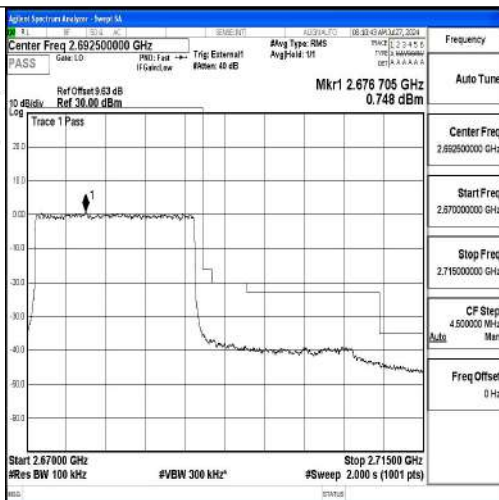

Band41-20MHz-QPSK-41490-100RB#0-PASS

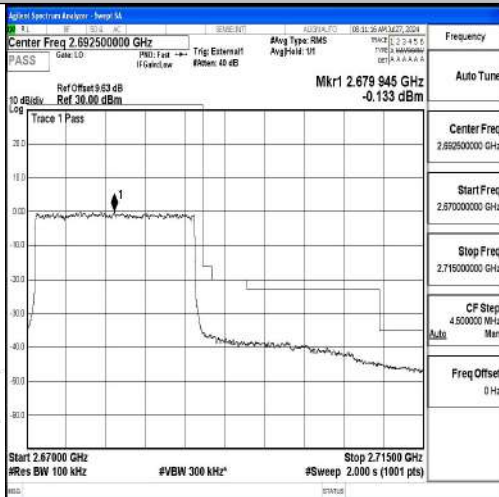

Band41-20MHz-16QAM-41490-100RB#0-PASS

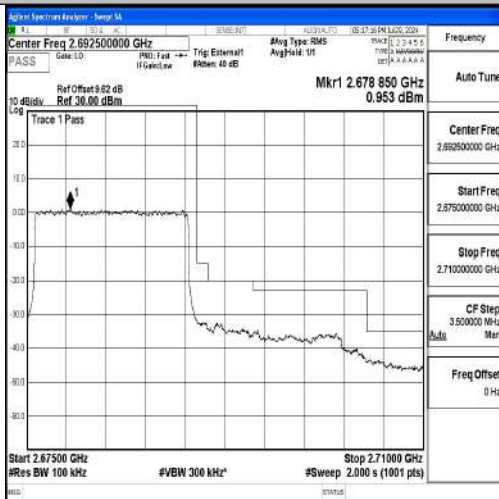

Band41-15MHz-QPSK-41515-75RB#0-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

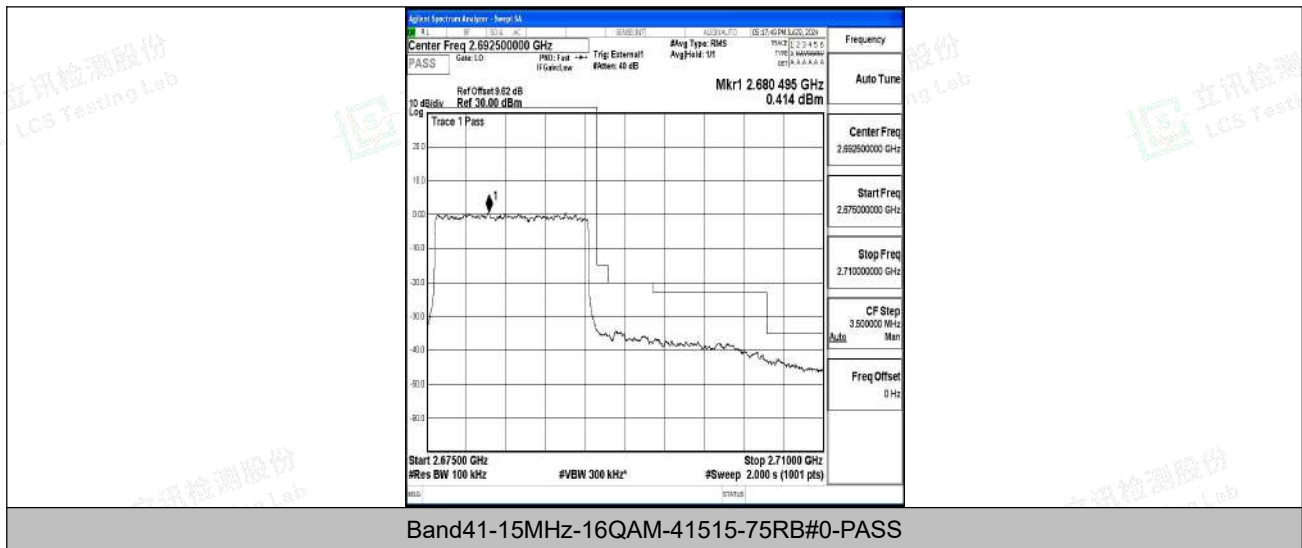

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



H.5 Conducted Spurious Emission

Test Result

Band	Bandwidth	Modulation	Channel	RB Configuration	Frequency Range	Result (dBm)	Verdict
Band41	5MHz	QPSK	39675	1RB#0	0.009~0.15	-79.88	PASS
Band41	5MHz	QPSK	39675	1RB#0	0.15~30	-67.13	PASS
Band41	5MHz	QPSK	39675	1RB#0	30~1000	-61.07	PASS
Band41	5MHz	QPSK	39675	1RB#0	1000~3000	-44.66	PASS
Band41	5MHz	QPSK	39675	1RB#0	3000~18000	-43.61	PASS
Band41	5MHz	QPSK	39675	1RB#0	18000~27000	-39.31	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.009~0.15	-78.50	PASS
Band41	5MHz	16QAM	39675	1RB#0	0.15~30	-67.51	PASS
Band41	5MHz	16QAM	39675	1RB#0	30~1000	-61.25	PASS
Band41	5MHz	16QAM	39675	1RB#0	1000~3000	-43.52	PASS
Band41	5MHz	16QAM	39675	1RB#0	3000~18000	-43.20	PASS
Band41	5MHz	16QAM	39675	1RB#0	18000~27000	-39.19	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.009~0.15	-78.89	PASS
Band41	5MHz	QPSK	40620	1RB#0	0.15~30	-53.54	PASS
Band41	5MHz	QPSK	40620	1RB#0	30~1000	-60.58	PASS
Band41	5MHz	QPSK	40620	1RB#0	1000~3000	-44.76	PASS
Band41	5MHz	QPSK	40620	1RB#0	3000~18000	-43.24	PASS
Band41	5MHz	QPSK	40620	1RB#0	18000~27000	-39.24	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.009~0.15	-78.37	PASS
Band41	5MHz	16QAM	40620	1RB#0	0.15~30	-54.27	PASS
Band41	5MHz	16QAM	40620	1RB#0	30~1000	-60.87	PASS
Band41	5MHz	16QAM	40620	1RB#0	1000~3000	-44.98	PASS
Band41	5MHz	16QAM	40620	1RB#0	3000~18000	-43.87	PASS
Band41	5MHz	16QAM	40620	1RB#0	18000~27000	-39.28	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.009~0.15	-76.59	PASS
Band41	5MHz	QPSK	41565	1RB#0	0.15~30	-67.80	PASS
Band41	5MHz	QPSK	41565	1RB#0	30~1000	-60.57	PASS
Band41	5MHz	QPSK	41565	1RB#0	1000~3000	-44.52	PASS
Band41	5MHz	QPSK	41565	1RB#0	3000~18000	-43.82	PASS
Band41	5MHz	QPSK	41565	1RB#0	18000~27000	-39.00	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.009~0.15	-76.59	PASS
Band41	5MHz	16QAM	41565	1RB#0	0.15~30	-66.98	PASS
Band41	5MHz	16QAM	41565	1RB#0	30~1000	-60.65	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	5MHz	16QAM	41565	1RB#0	1000~3000	-44.34	PASS
Band41	5MHz	16QAM	41565	1RB#0	3000~18000	-43.88	PASS
Band41	5MHz	16QAM	41565	1RB#0	18000~27000	-39.31	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.009~0.15	-78.28	PASS
Band41	10MHz	QPSK	39700	1RB#0	0.15~30	-68.44	PASS
Band41	10MHz	QPSK	39700	1RB#0	30~1000	-60.74	PASS
Band41	10MHz	QPSK	39700	1RB#0	1000~3000	-44.70	PASS
Band41	10MHz	QPSK	39700	1RB#0	3000~18000	-43.71	PASS
Band41	10MHz	QPSK	39700	1RB#0	18000~27000	-39.47	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.009~0.15	-76.53	PASS
Band41	10MHz	16QAM	39700	1RB#0	0.15~30	-69.33	PASS
Band41	10MHz	16QAM	39700	1RB#0	30~1000	-61.03	PASS
Band41	10MHz	16QAM	39700	1RB#0	1000~3000	-44.84	PASS
Band41	10MHz	16QAM	39700	1RB#0	3000~18000	-43.94	PASS
Band41	10MHz	16QAM	39700	1RB#0	18000~27000	-39.14	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.009~0.15	-78.31	PASS
Band41	10MHz	QPSK	40620	1RB#0	0.15~30	-51.74	PASS
Band41	10MHz	QPSK	40620	1RB#0	30~1000	-60.85	PASS
Band41	10MHz	QPSK	40620	1RB#0	1000~3000	-44.62	PASS
Band41	10MHz	QPSK	40620	1RB#0	3000~18000	-43.67	PASS
Band41	10MHz	QPSK	40620	1RB#0	18000~27000	-39.19	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.009~0.15	-76.81	PASS
Band41	10MHz	16QAM	40620	1RB#0	0.15~30	-52.05	PASS
Band41	10MHz	16QAM	40620	1RB#0	30~1000	-60.97	PASS
Band41	10MHz	16QAM	40620	1RB#0	1000~3000	-44.80	PASS
Band41	10MHz	16QAM	40620	1RB#0	3000~18000	-43.73	PASS
Band41	10MHz	16QAM	40620	1RB#0	18000~27000	-39.09	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.009~0.15	-76.96	PASS
Band41	10MHz	QPSK	41540	1RB#0	0.15~30	-66.33	PASS
Band41	10MHz	QPSK	41540	1RB#0	30~1000	-60.08	PASS
Band41	10MHz	QPSK	41540	1RB#0	1000~3000	-44.43	PASS
Band41	10MHz	QPSK	41540	1RB#0	3000~18000	-43.88	PASS
Band41	10MHz	QPSK	41540	1RB#0	18000~27000	-39.09	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.009~0.15	-75.58	PASS
Band41	10MHz	16QAM	41540	1RB#0	0.15~30	-68.53	PASS
Band41	10MHz	16QAM	41540	1RB#0	30~1000	-60.73	PASS
Band41	10MHz	16QAM	41540	1RB#0	1000~3000	-44.54	PASS
Band41	10MHz	16QAM	41540	1RB#0	3000~18000	-43.77	PASS
Band41	10MHz	16QAM	41540	1RB#0	18000~27000	-39.05	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	15MHz	QPSK	39725	1RB#0	0.009~0.15	-78.27	PASS
Band41	15MHz	QPSK	39725	1RB#0	0.15~30	-67.06	PASS
Band41	15MHz	QPSK	39725	1RB#0	30~1000	-61.03	PASS
Band41	15MHz	QPSK	39725	1RB#0	1000~3000	-43.21	PASS
Band41	15MHz	QPSK	39725	1RB#0	3000~18000	-43.54	PASS
Band41	15MHz	QPSK	39725	1RB#0	18000~27000	-38.62	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.009~0.15	-75.99	PASS
Band41	15MHz	16QAM	39725	1RB#0	0.15~30	-67.46	PASS
Band41	15MHz	16QAM	39725	1RB#0	30~1000	-60.81	PASS
Band41	15MHz	16QAM	39725	1RB#0	1000~3000	-43.52	PASS
Band41	15MHz	16QAM	39725	1RB#0	3000~18000	-43.23	PASS
Band41	15MHz	16QAM	39725	1RB#0	18000~27000	-39.25	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.009~0.15	-78.38	PASS
Band41	15MHz	QPSK	40620	1RB#0	0.15~30	-52.22	PASS
Band41	15MHz	QPSK	40620	1RB#0	30~1000	-60.85	PASS
Band41	15MHz	QPSK	40620	1RB#0	1000~3000	-43.51	PASS
Band41	15MHz	QPSK	40620	1RB#0	3000~18000	-43.67	PASS
Band41	15MHz	QPSK	40620	1RB#0	18000~27000	-39.37	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.009~0.15	-77.32	PASS
Band41	15MHz	16QAM	40620	1RB#0	0.15~30	-53.84	PASS
Band41	15MHz	16QAM	40620	1RB#0	30~1000	-60.97	PASS
Band41	15MHz	16QAM	40620	1RB#0	1000~3000	-43.83	PASS
Band41	15MHz	16QAM	40620	1RB#0	3000~18000	-43.64	PASS
Band41	15MHz	16QAM	40620	1RB#0	18000~27000	-39.34	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.009~0.15	-77.26	PASS
Band41	15MHz	QPSK	41515	1RB#0	0.15~30	-66.92	PASS
Band41	15MHz	QPSK	41515	1RB#0	30~1000	-60.20	PASS
Band41	15MHz	QPSK	41515	1RB#0	1000~3000	-42.17	PASS
Band41	15MHz	QPSK	41515	1RB#0	3000~18000	-43.72	PASS
Band41	15MHz	QPSK	41515	1RB#0	18000~27000	-39.35	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.009~0.15	-76.47	PASS
Band41	15MHz	16QAM	41515	1RB#0	0.15~30	-70.08	PASS
Band41	15MHz	16QAM	41515	1RB#0	30~1000	-60.94	PASS
Band41	15MHz	16QAM	41515	1RB#0	1000~3000	-42.50	PASS
Band41	15MHz	16QAM	41515	1RB#0	3000~18000	-43.58	PASS
Band41	15MHz	16QAM	41515	1RB#0	18000~27000	-39.13	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.009~0.15	-78.67	PASS
Band41	20MHz	QPSK	39750	1RB#0	0.15~30	-69.30	PASS
Band41	20MHz	QPSK	39750	1RB#0	30~1000	-60.89	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Band41	20MHz	QPSK	39750	1RB#0	1000~3000	-44.27	PASS
Band41	20MHz	QPSK	39750	1RB#0	3000~18000	-43.74	PASS
Band41	20MHz	QPSK	39750	1RB#0	18000~27000	-38.68	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.009~0.15	-78.61	PASS
Band41	20MHz	16QAM	39750	1RB#0	0.15~30	-69.01	PASS
Band41	20MHz	16QAM	39750	1RB#0	30~1000	-60.87	PASS
Band41	20MHz	16QAM	39750	1RB#0	1000~3000	-44.14	PASS
Band41	20MHz	16QAM	39750	1RB#0	3000~18000	-43.67	PASS
Band41	20MHz	16QAM	39750	1RB#0	18000~27000	-39.22	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.009~0.15	-77.26	PASS
Band41	20MHz	QPSK	40620	1RB#0	0.15~30	-53.02	PASS
Band41	20MHz	QPSK	40620	1RB#0	30~1000	-61.15	PASS
Band41	20MHz	QPSK	40620	1RB#0	1000~3000	-41.51	PASS
Band41	20MHz	QPSK	40620	1RB#0	3000~18000	-43.72	PASS
Band41	20MHz	QPSK	40620	1RB#0	18000~27000	-39.20	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.009~0.15	-76.14	PASS
Band41	20MHz	16QAM	40620	1RB#0	0.15~30	-52.96	PASS
Band41	20MHz	16QAM	40620	1RB#0	30~1000	-60.84	PASS
Band41	20MHz	16QAM	40620	1RB#0	1000~3000	-42.95	PASS
Band41	20MHz	16QAM	40620	1RB#0	3000~18000	-43.65	PASS
Band41	20MHz	16QAM	40620	1RB#0	18000~27000	-39.21	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.009~0.15	-77.41	PASS
Band41	20MHz	QPSK	41490	1RB#0	0.15~30	-67.79	PASS
Band41	20MHz	QPSK	41490	1RB#0	30~1000	-60.78	PASS
Band41	20MHz	QPSK	41490	1RB#0	1000~3000	-41.16	PASS
Band41	20MHz	QPSK	41490	1RB#0	3000~18000	-43.47	PASS
Band41	20MHz	QPSK	41490	1RB#0	18000~27000	-39.26	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.009~0.15	-76.02	PASS
Band41	20MHz	16QAM	41490	1RB#0	0.15~30	-69.14	PASS
Band41	20MHz	16QAM	41490	1RB#0	30~1000	-60.02	PASS
Band41	20MHz	16QAM	41490	1RB#0	1000~3000	-40.90	PASS
Band41	20MHz	16QAM	41490	1RB#0	3000~18000	-43.92	PASS
Band41	20MHz	16QAM	41490	1RB#0	18000~27000	-39.24	PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Test Graphs

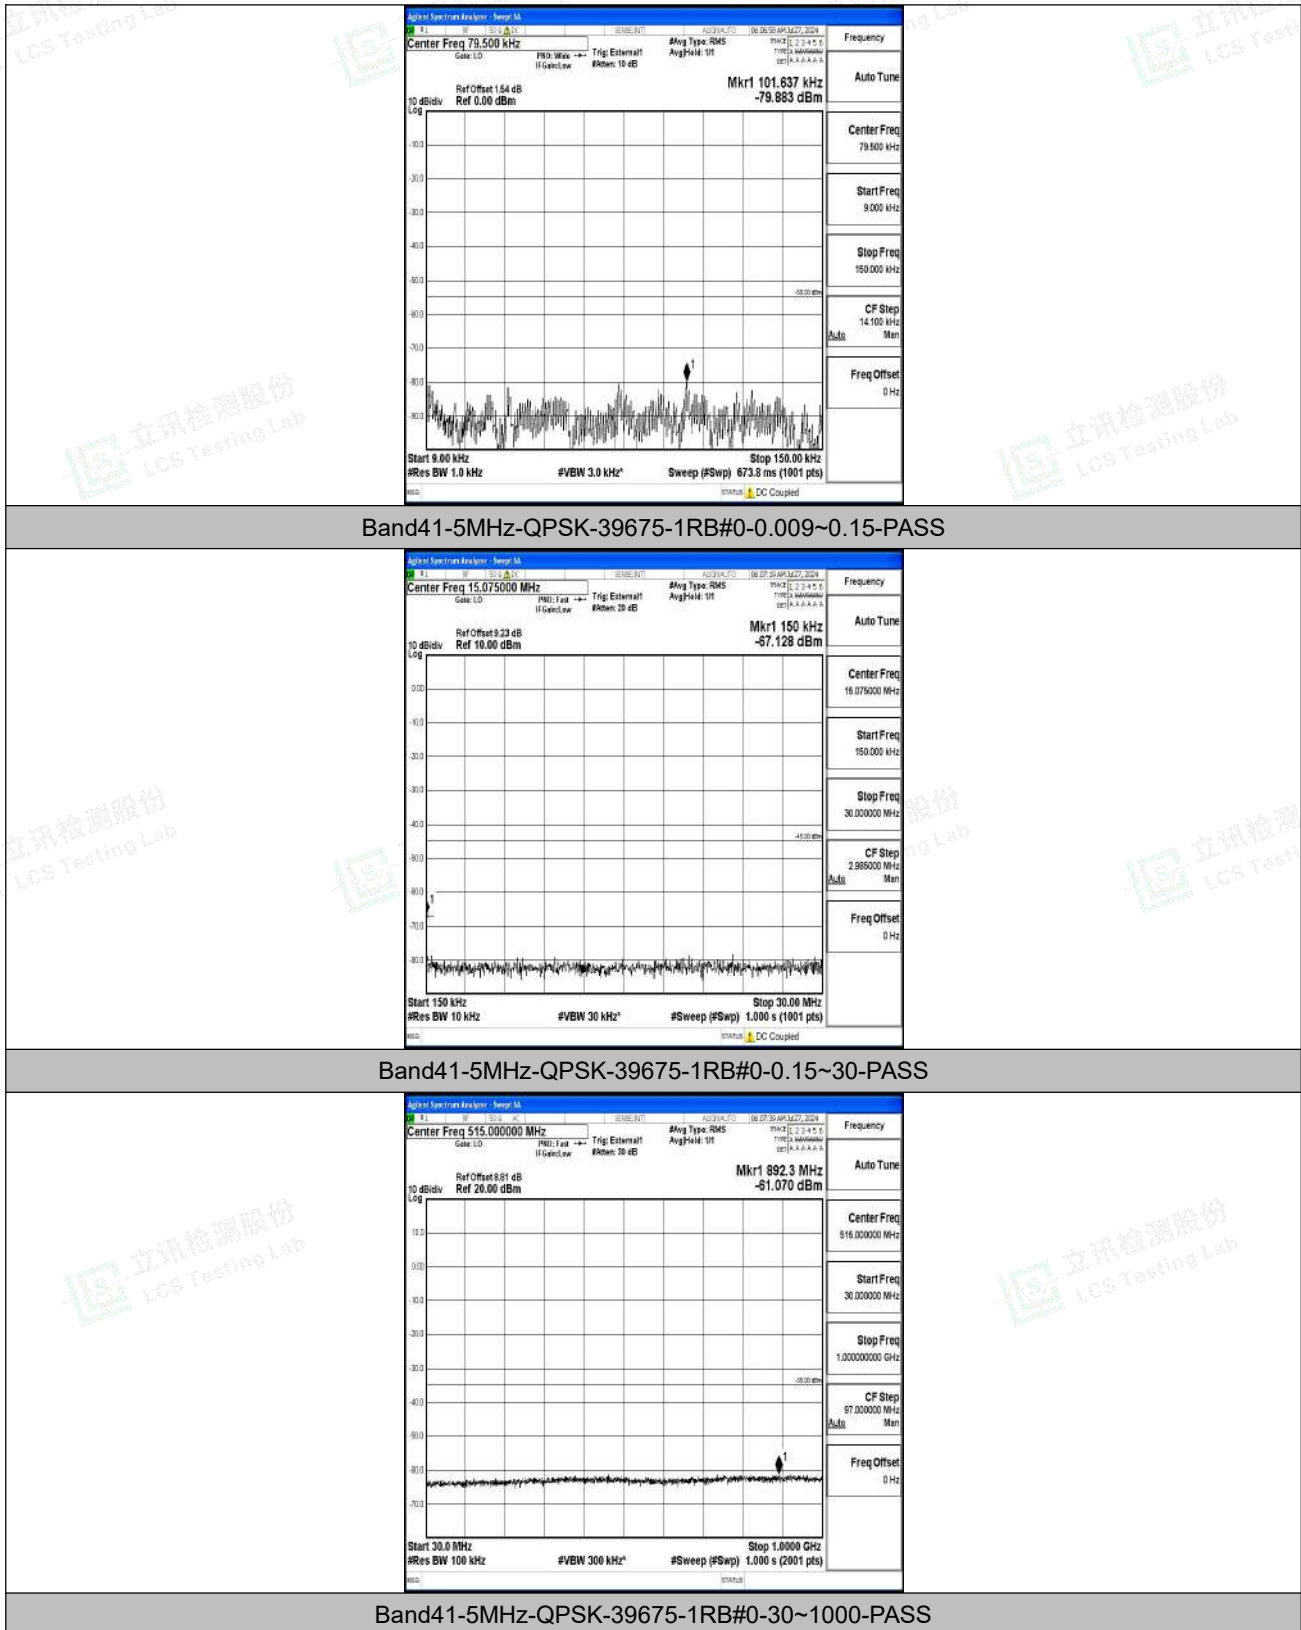


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

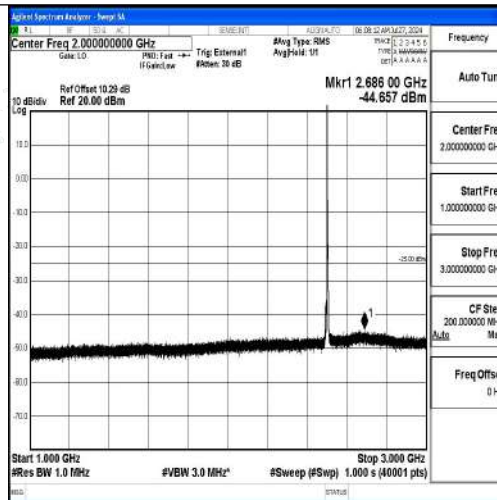

Band41-5MHz-QPSK-39675-1RB#0-1000~3000-PASS

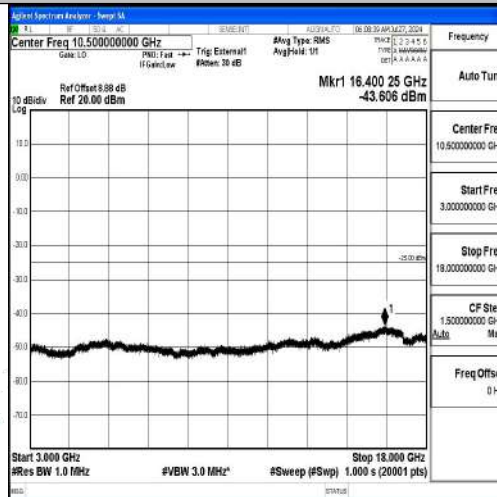

Band41-5MHz-QPSK-39675-1RB#0-3000~18000-PASS

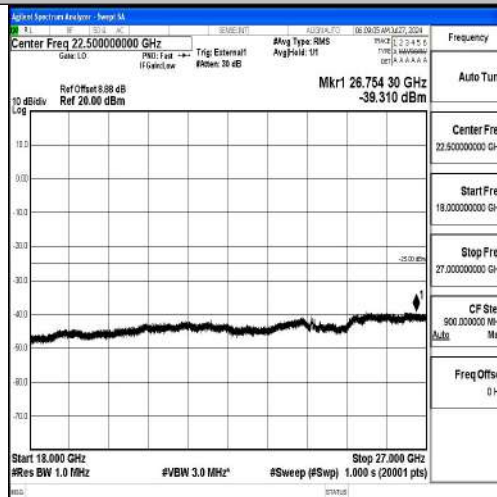

Band41-5MHz-QPSK-39675-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

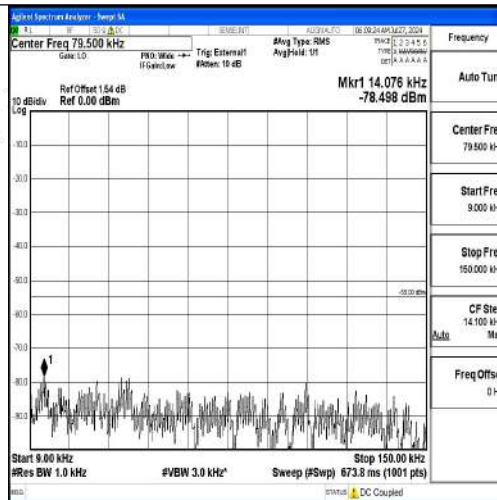

Band41-5MHz-16QAM-39675-1RB#0-0.009~0.15-PASS

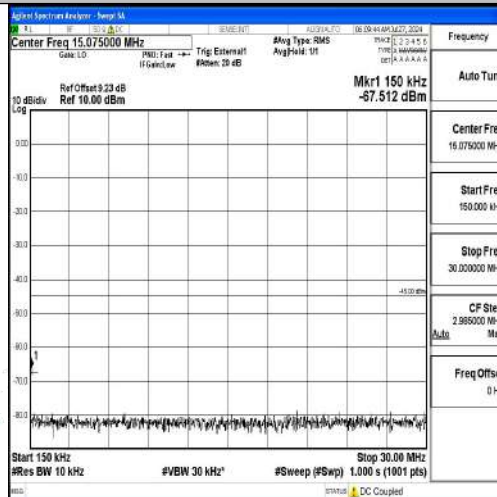

Band41-5MHz-16QAM-39675-1RB#0-0.15~30-PASS

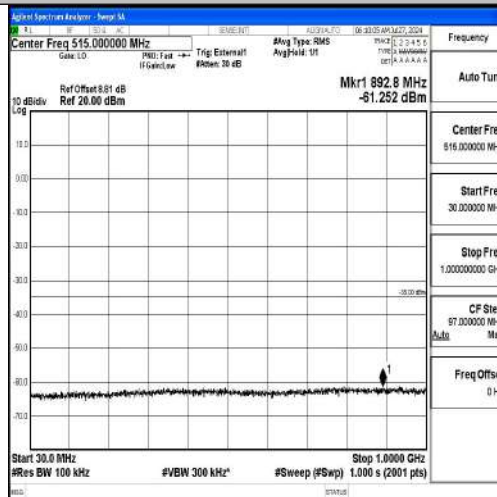

Band41-5MHz-16QAM-39675-1RB#0-30~1000-PASS







Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

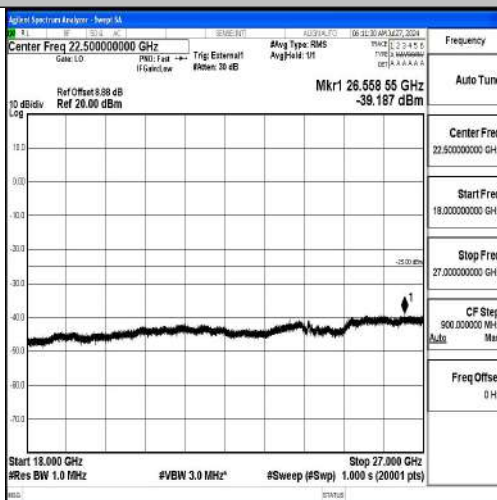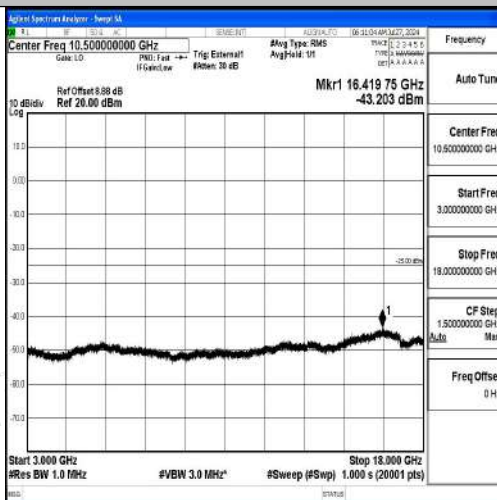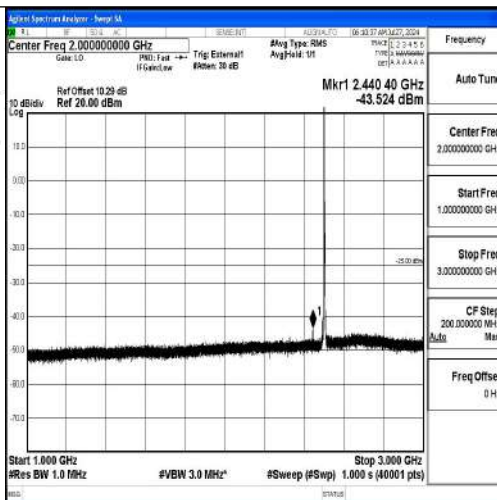


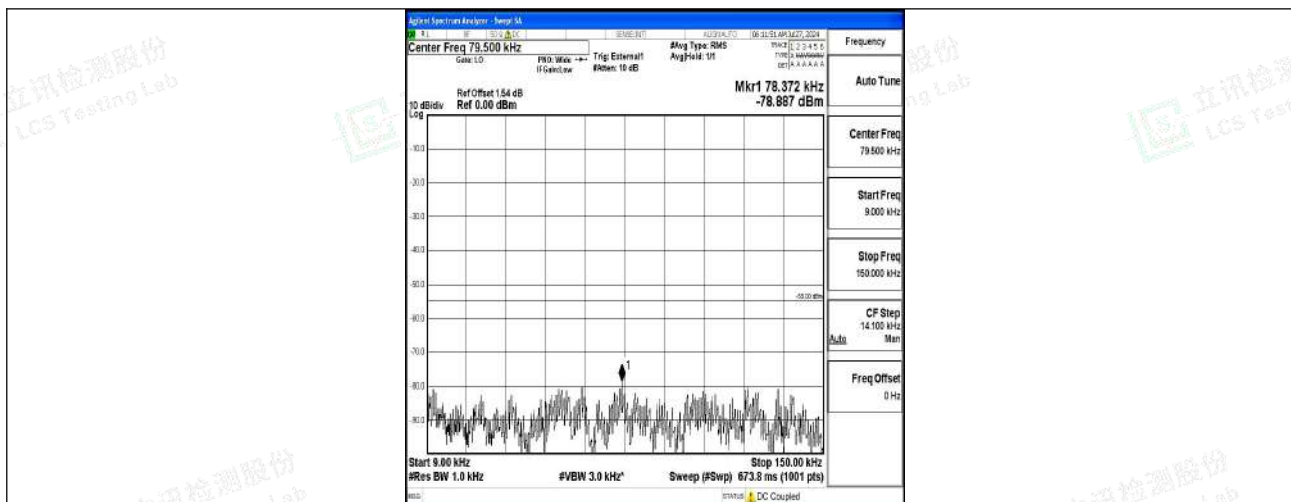

Band41-5MHz-QPSK-40620-1RB#0-0.009~0.15-PASS

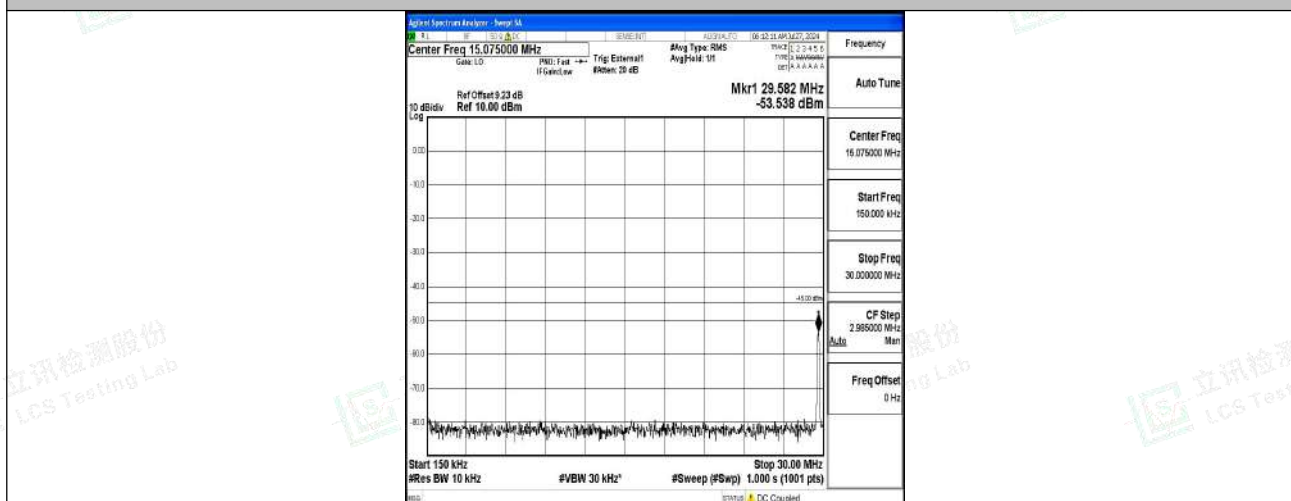

Band41-5MHz-QPSK-40620-1RB#0-0.15~30-PASS

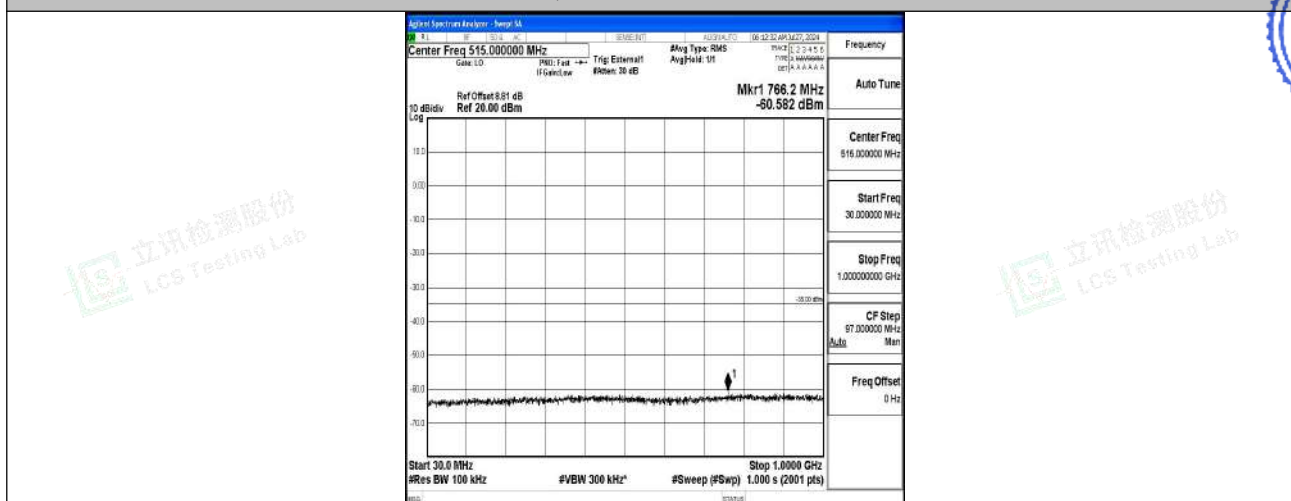

Band41-5MHz-QPSK-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

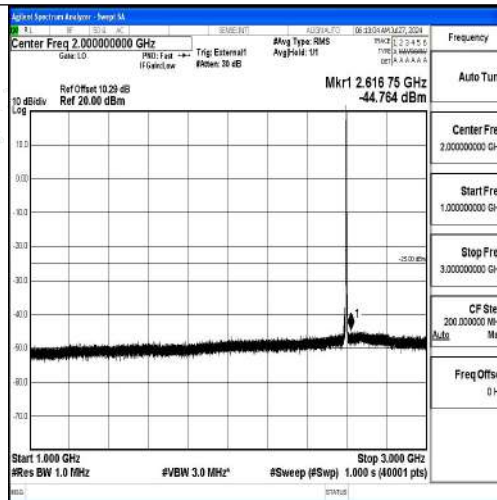

Band41-5MHz-QPSK-40620-1RB#0-1000~3000-PASS

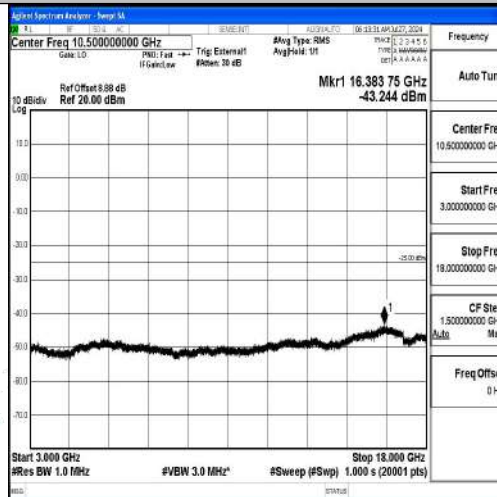

Band41-5MHz-QPSK-40620-1RB#0-3000~18000-PASS

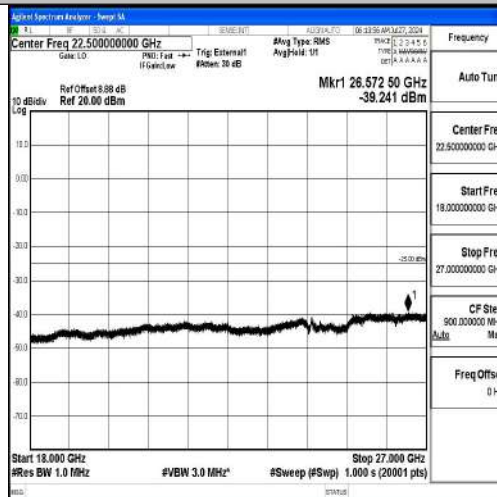

Band41-5MHz-QPSK-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

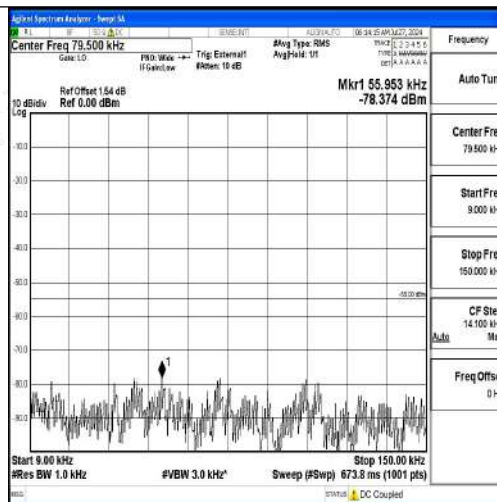

Band41-5MHz-16QAM-40620-1RB#0-0.009~0.15-PASS

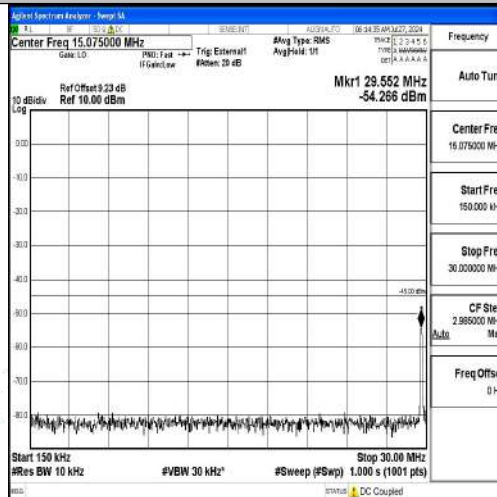

Band41-5MHz-16QAM-40620-1RB#0-0.15~30-PASS

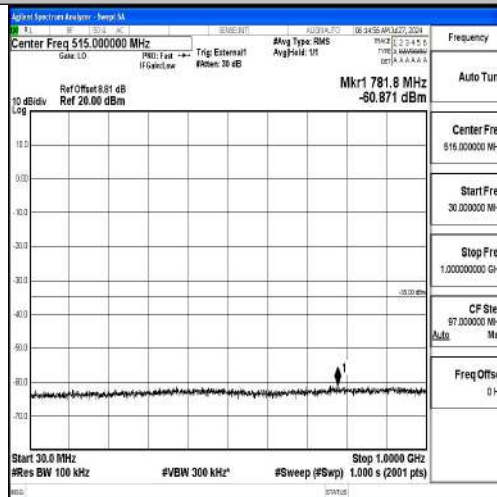

Band41-5MHz-16QAM-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

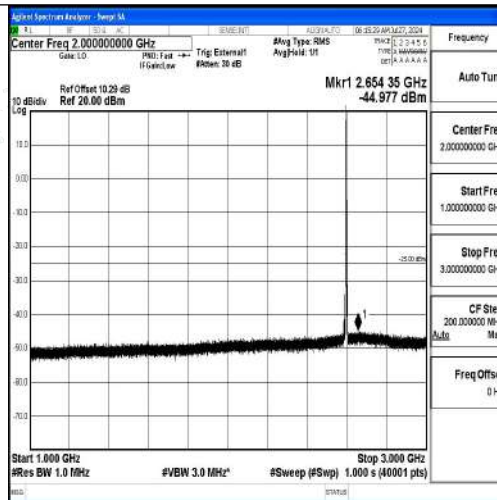

Band41-5MHz-16QAM-40620-1RB#0-1000~3000-PASS

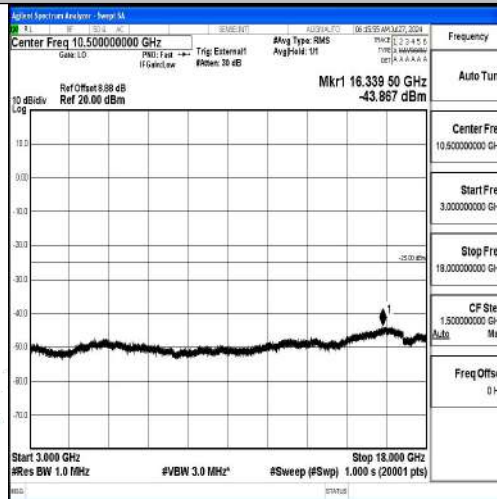

Band41-5MHz-16QAM-40620-1RB#0-3000~18000-PASS

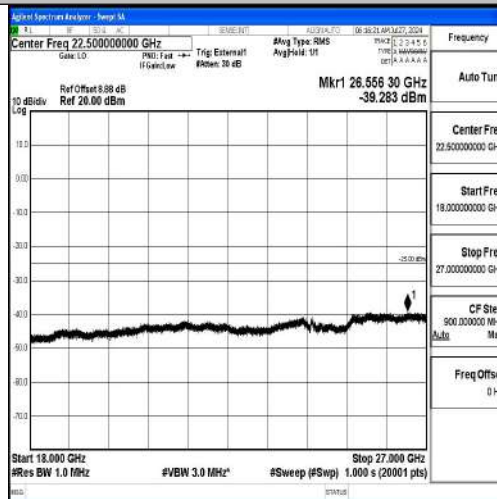

Band41-5MHz-16QAM-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

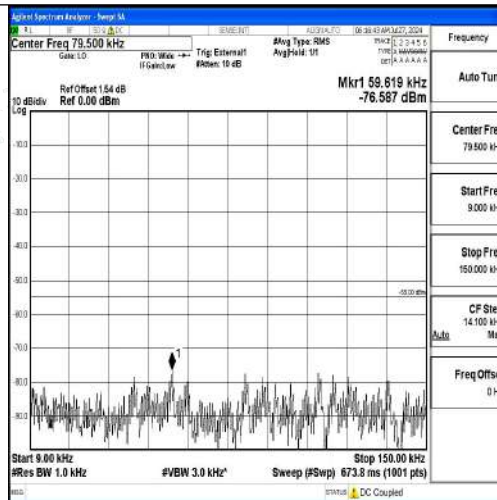

Band41-5MHz-QPSK-41565-1RB#0-0.009~0.15-PASS

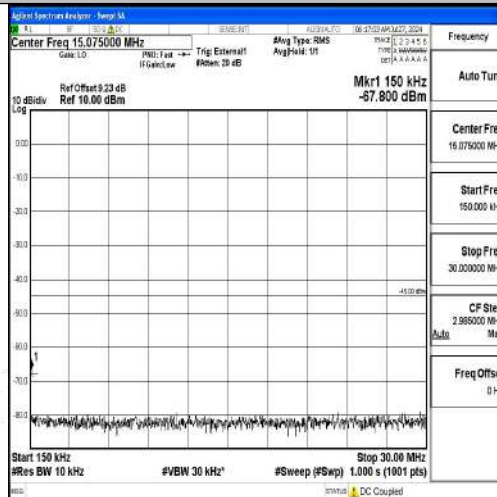

Band41-5MHz-QPSK-41565-1RB#0-0.15~30-PASS

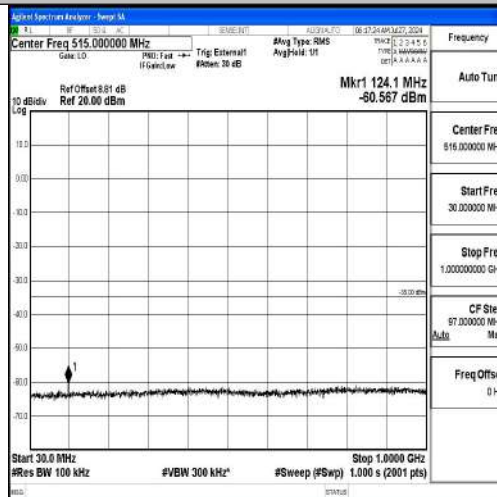

Band41-5MHz-QPSK-41565-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

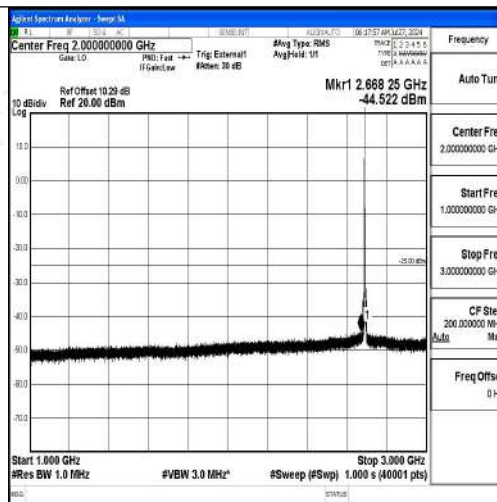

Band41-5MHz-QPSK-41565-1RB#0-1000~3000-PASS

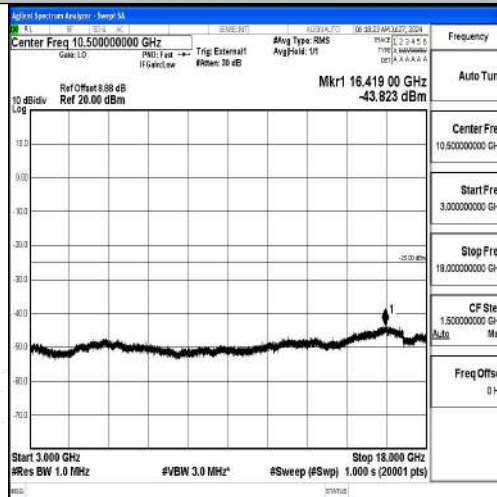

Band41-5MHz-QPSK-41565-1RB#0-3000~18000-PASS

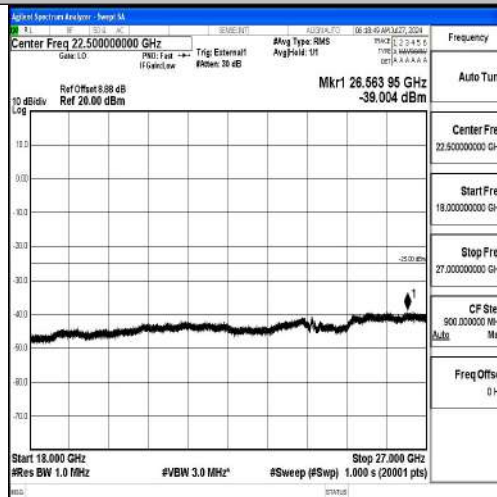

Band41-5MHz-QPSK-41565-1RB#0-18000~27000-PASS







Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




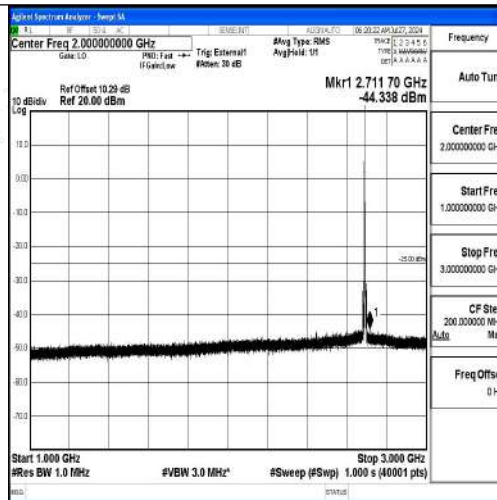

Band41-5MHz-16QAM-41565-1RB#0-1000~3000-PASS

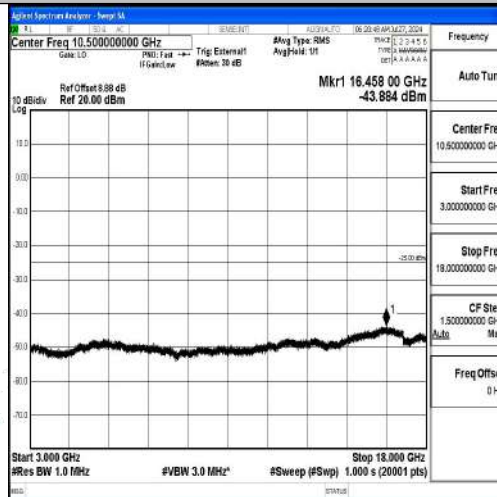

Band41-5MHz-16QAM-41565-1RB#0-3000~18000-PASS

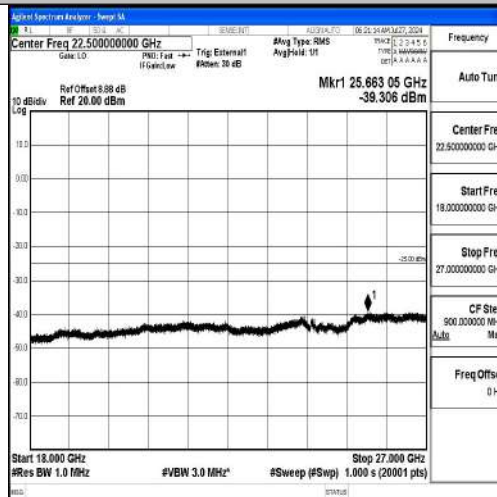

Band41-5MHz-16QAM-41565-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

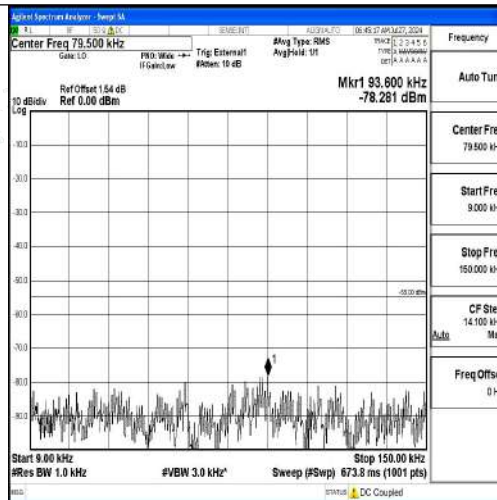

Band41-10MHz-QPSK-39700-1RB#0-0.009~0.15-PASS

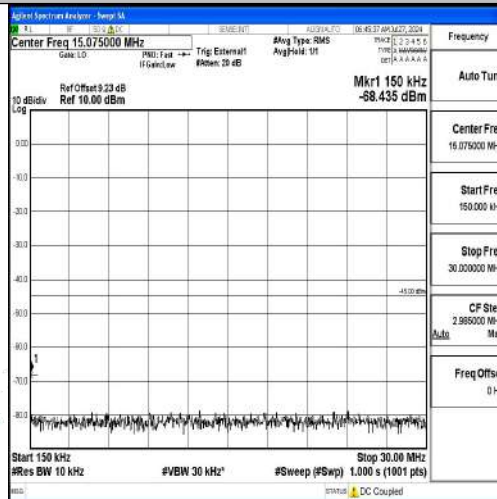

Band41-10MHz-QPSK-39700-1RB#0-0.15~30-PASS

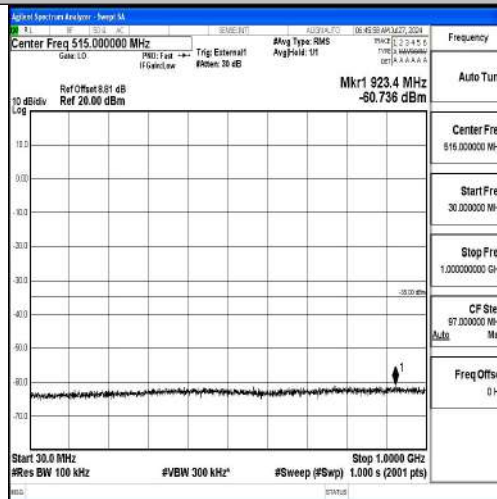

Band41-10MHz-QPSK-39700-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

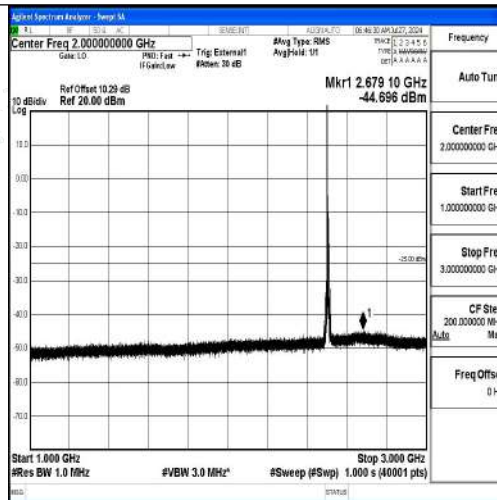

Band41-10MHz-QPSK-39700-1RB#0-1000~3000-PASS

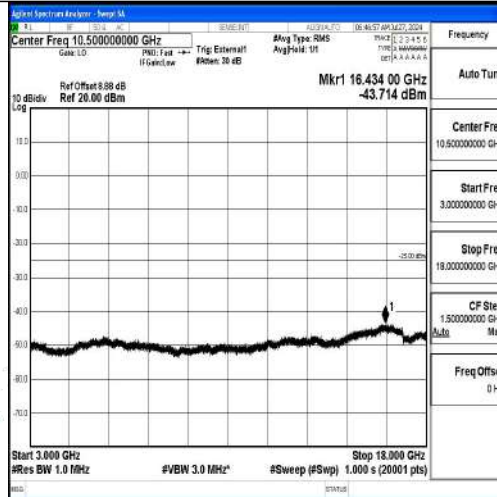

Band41-10MHz-QPSK-39700-1RB#0-3000~18000-PASS

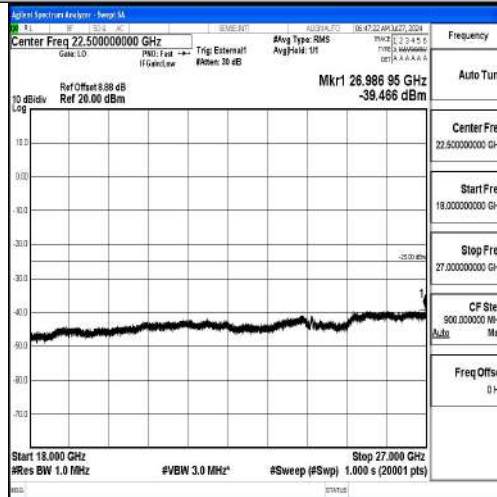

Band41-10MHz-QPSK-39700-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

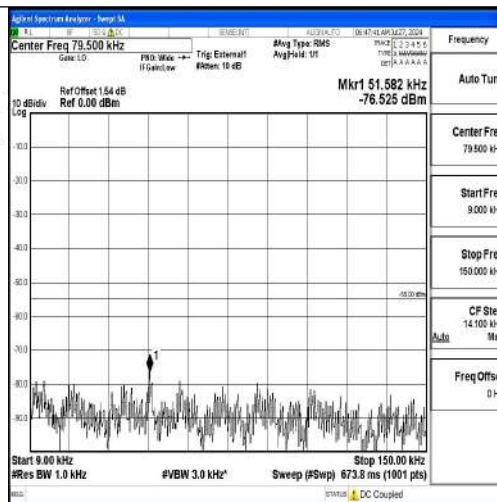

Band41-10MHz-16QAM-39700-1RB#0-0.009~0.15-PASS

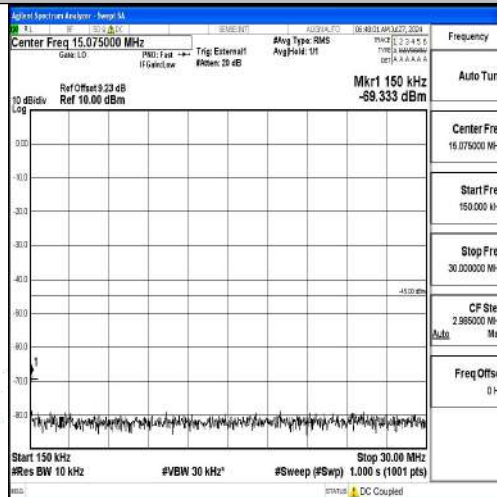

Band41-10MHz-16QAM-39700-1RB#0-0.15~30-PASS

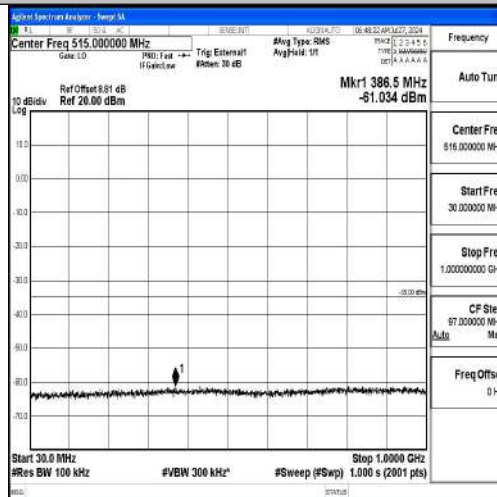

Band41-10MHz-16QAM-39700-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

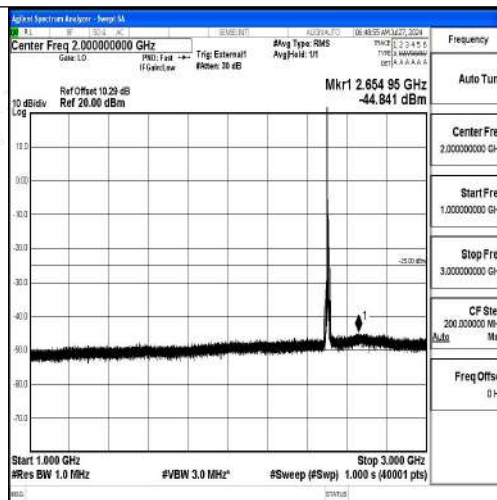

Band41-10MHz-16QAM-39700-1RB#0-1000~3000-PASS

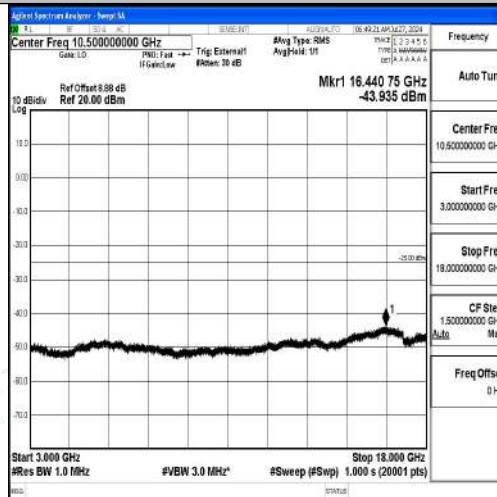

Band41-10MHz-16QAM-39700-1RB#0-3000~18000-PASS

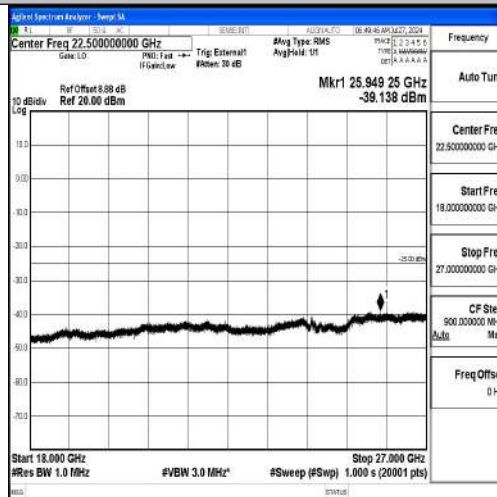

Band41-10MHz-16QAM-39700-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

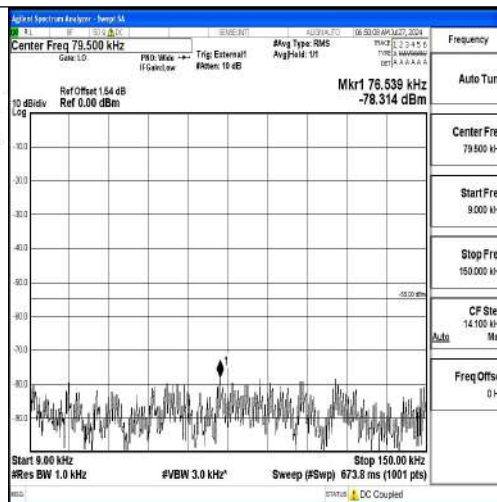

Band41-10MHz-QPSK-40620-1RB#0-0.009~0.15-PASS

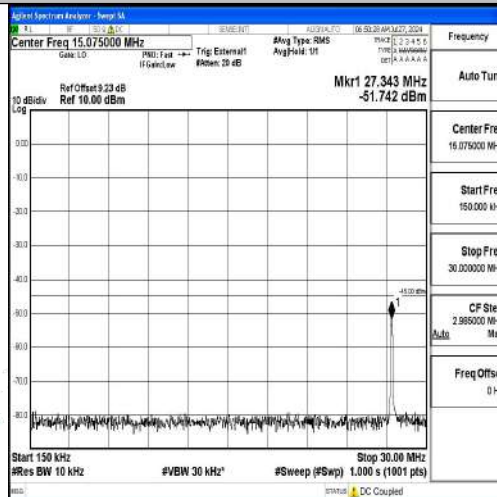

Band41-10MHz-QPSK-40620-1RB#0-0.15~30-PASS

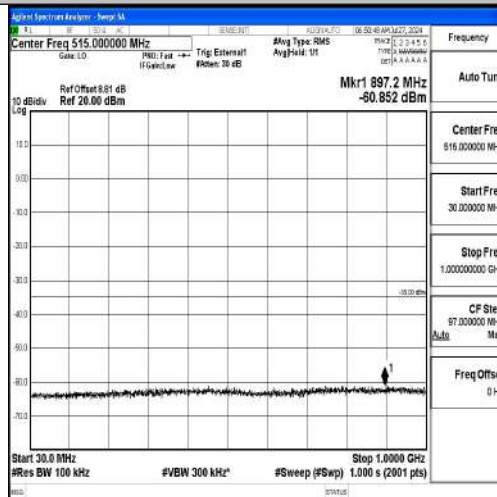

Band41-10MHz-QPSK-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

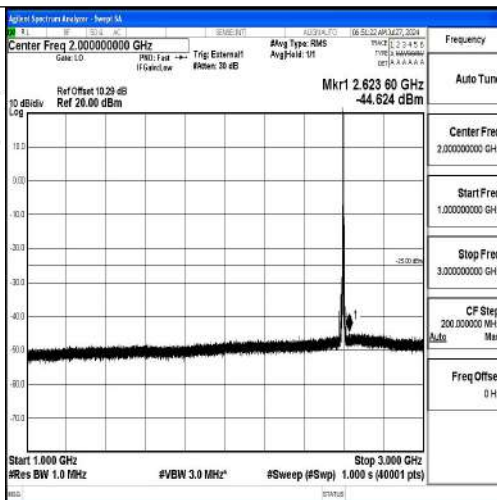

Band41-10MHz-QPSK-40620-1RB#0-1000~3000-PASS

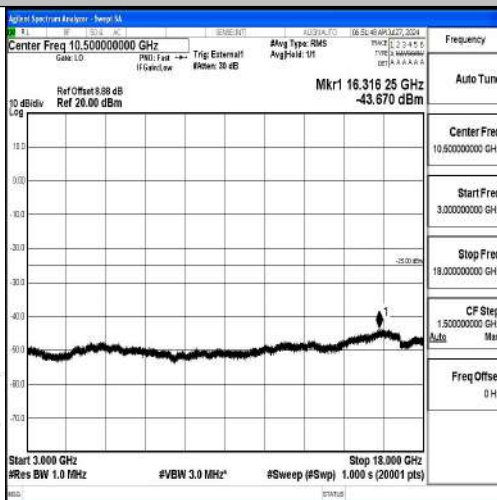

Band41-10MHz-QPSK-40620-1RB#0-3000~18000-PASS

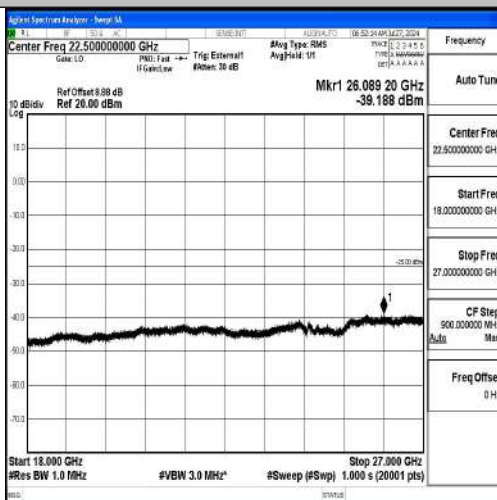

Band41-10MHz-QPSK-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

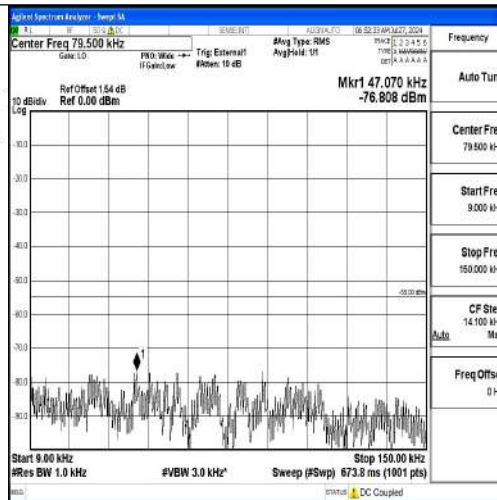

Band41-10MHz-16QAM-40620-1RB#0-0.009~0.15-PASS

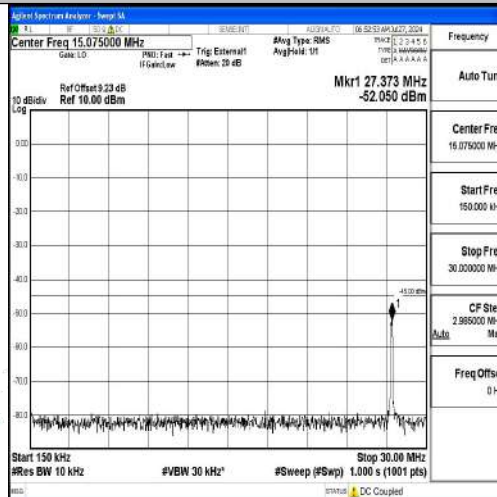

Band41-10MHz-16QAM-40620-1RB#0-0.15~30-PASS

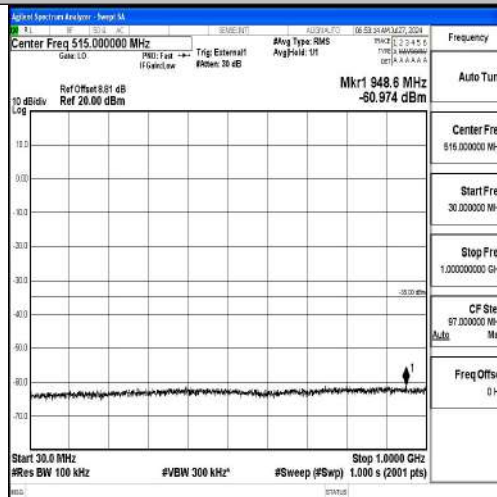

Band41-10MHz-16QAM-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

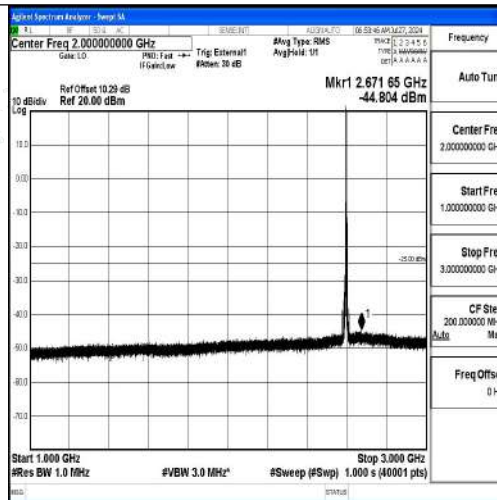

Band41-10MHz-16QAM-40620-1RB#0-1000~3000-PASS

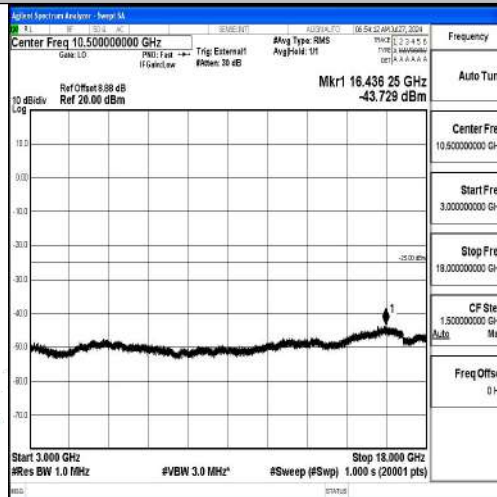

Band41-10MHz-16QAM-40620-1RB#0-3000~18000-PASS

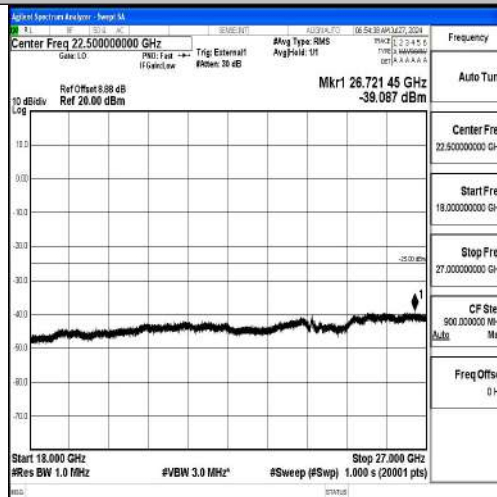

Band41-10MHz-16QAM-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

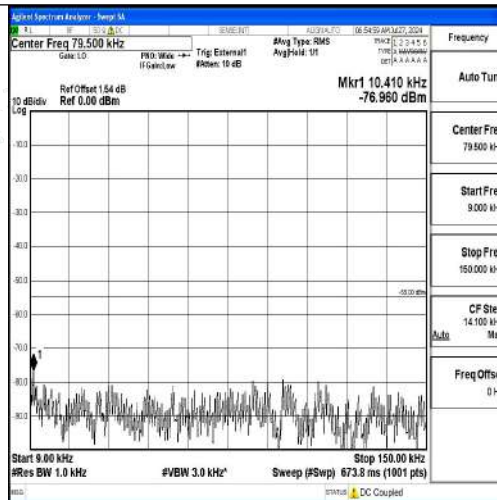

Band41-10MHz-QPSK-41540-1RB#0-0.009~0.15-PASS

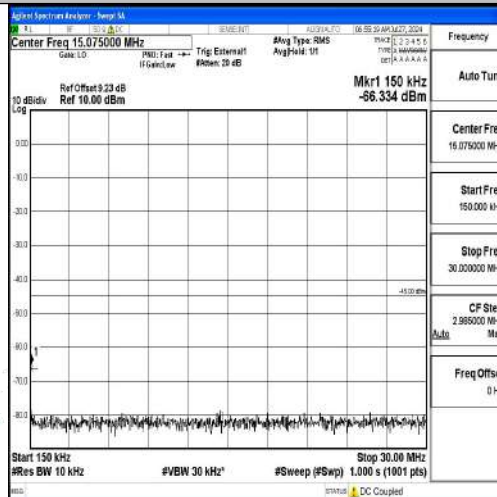

Band41-10MHz-QPSK-41540-1RB#0-0.15~30-PASS

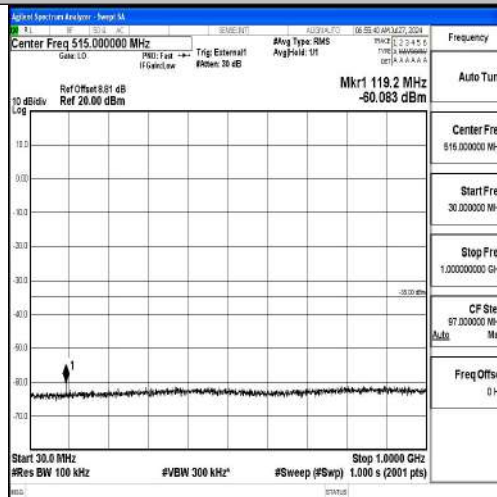

Band41-10MHz-QPSK-41540-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

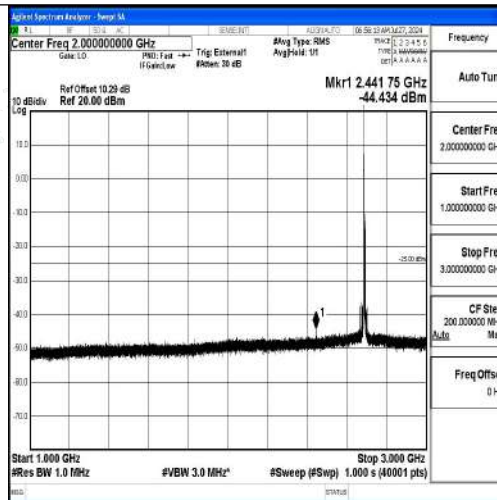

Band41-10MHz-QPSK-41540-1RB#0-1000~3000-PASS

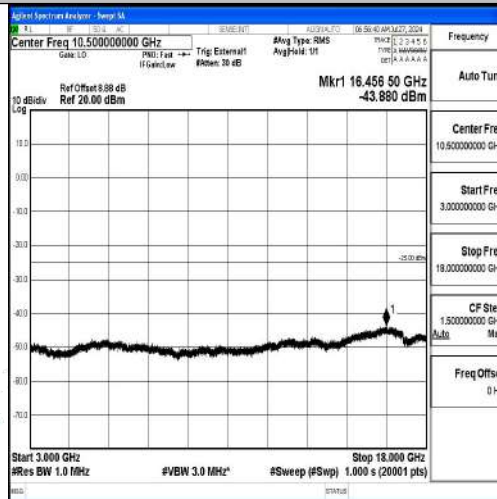

Band41-10MHz-QPSK-41540-1RB#0-3000~18000-PASS

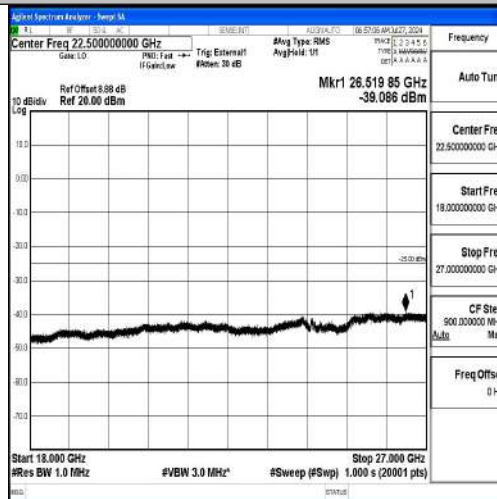

Band41-10MHz-QPSK-41540-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

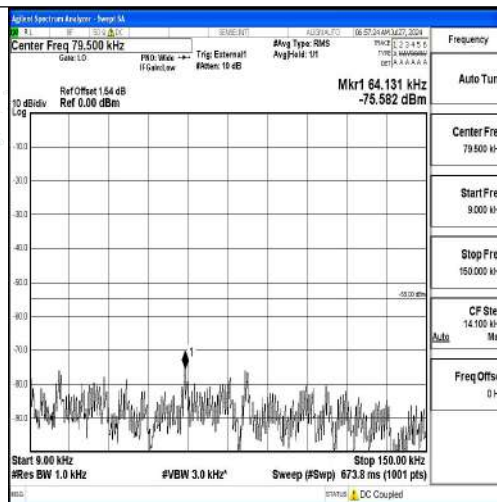

Band41-10MHz-16QAM-41540-1RB#0-0.009~0.15-PASS

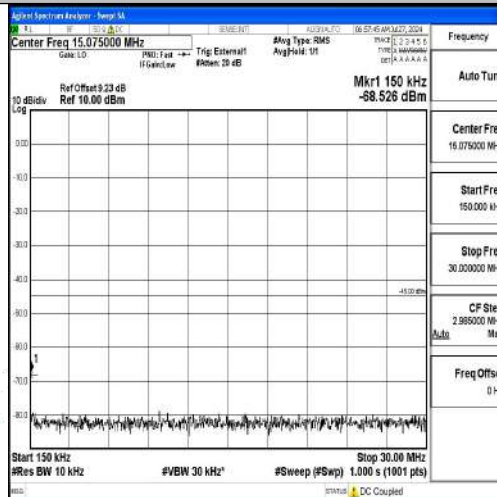

Band41-10MHz-16QAM-41540-1RB#0-0.15~30-PASS

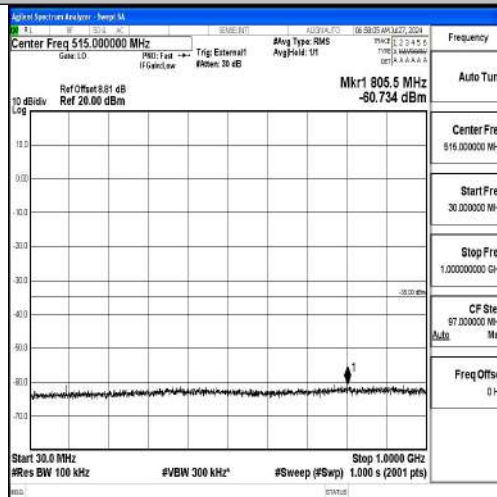

Band41-10MHz-16QAM-41540-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

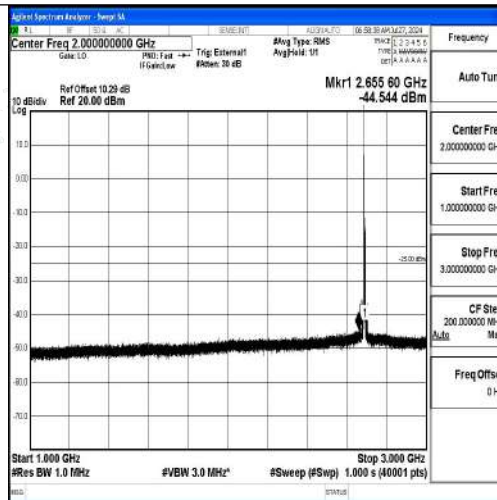

Band41-10MHz-16QAM-41540-1RB#0-1000~3000-PASS

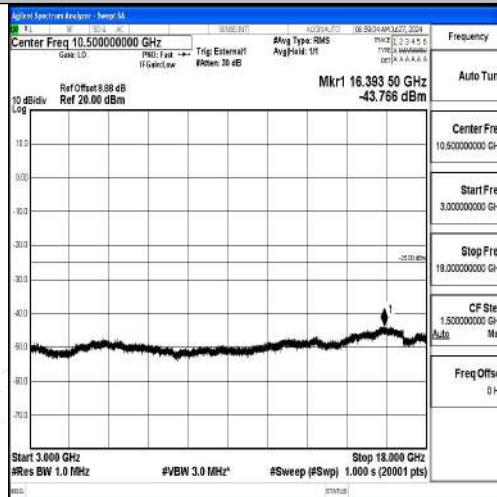

Band41-10MHz-16QAM-41540-1RB#0-3000~18000-PASS

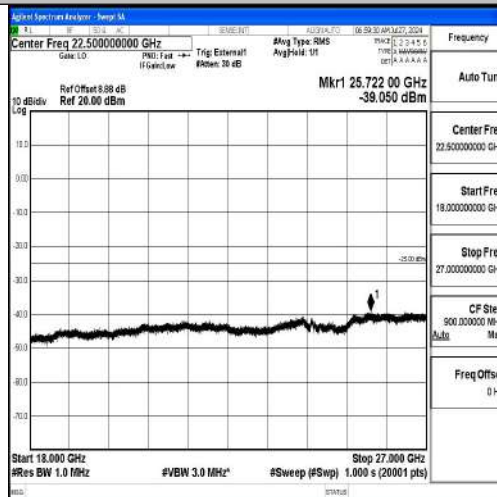

Band41-10MHz-16QAM-41540-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

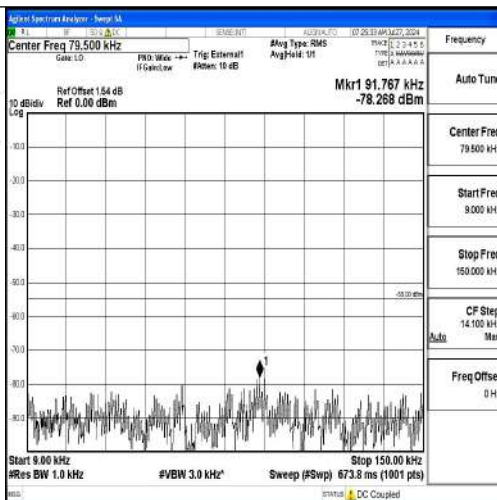

Band41-15MHz-QPSK-39725-1RB#0-0.009~0.15-PASS

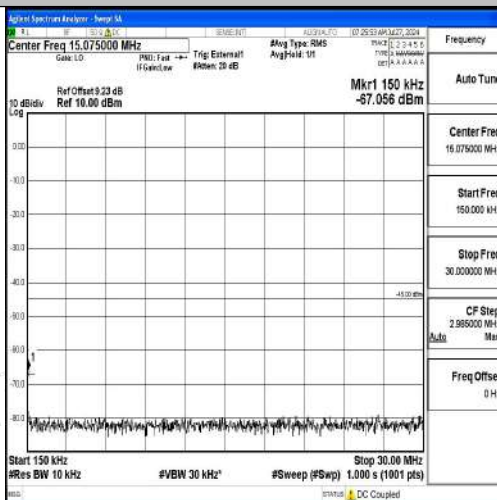

Band41-15MHz-QPSK-39725-1RB#0-0.15~30-PASS

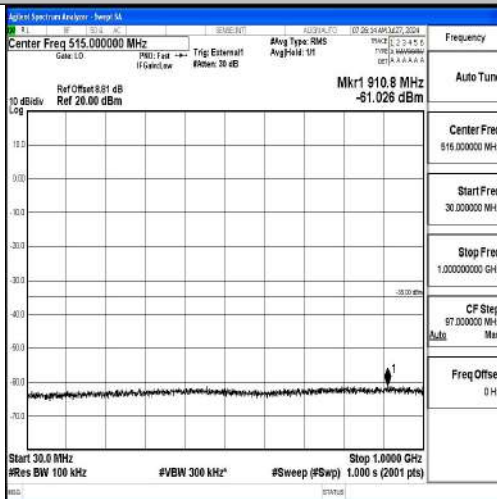

Band41-15MHz-QPSK-39725-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

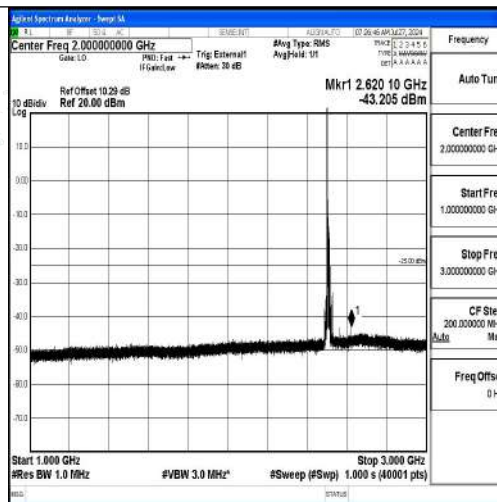

Band41-15MHz-QPSK-39725-1RB#0-1000~3000-PASS

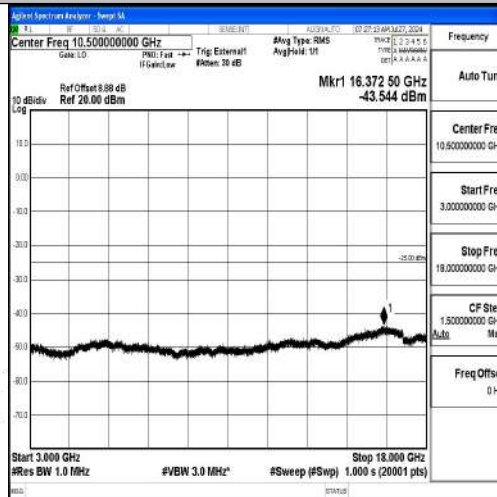

Band41-15MHz-QPSK-39725-1RB#0-3000~18000-PASS

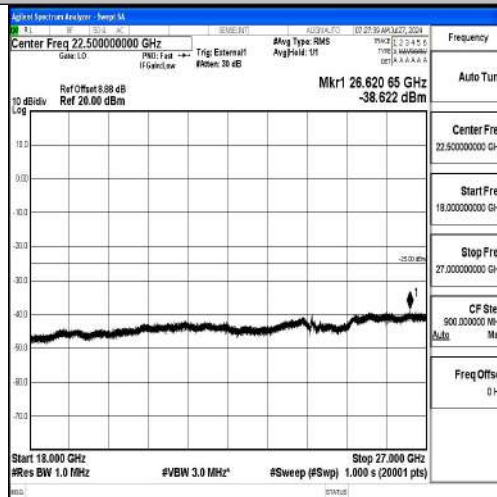

Band41-15MHz-QPSK-39725-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

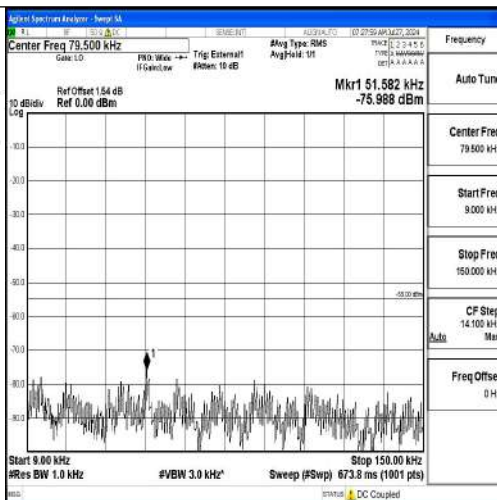

Band41-15MHz-16QAM-39725-1RB#0-0.009~0.15-PASS

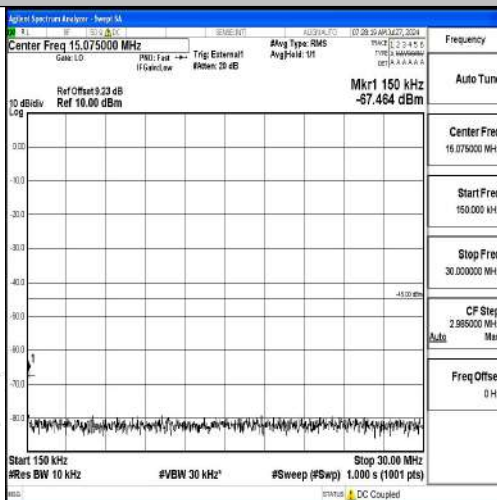

Band41-15MHz-16QAM-39725-1RB#0-0.15~30-PASS

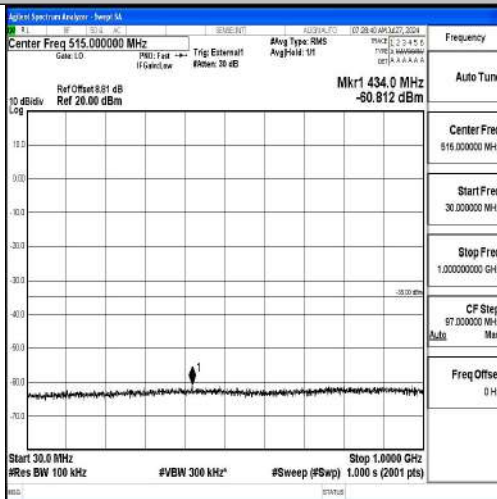

Band41-15MHz-16QAM-39725-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

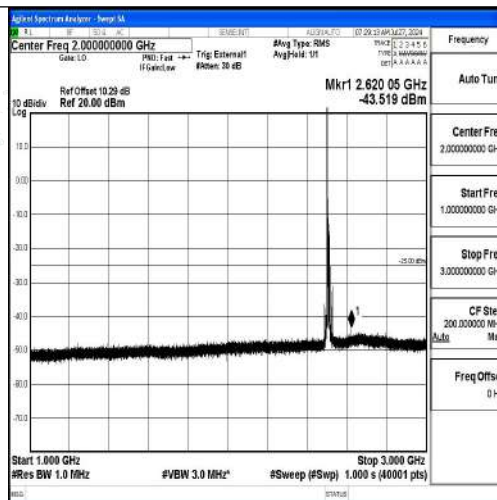

Band41-15MHz-16QAM-39725-1RB#0-1000~3000-PASS

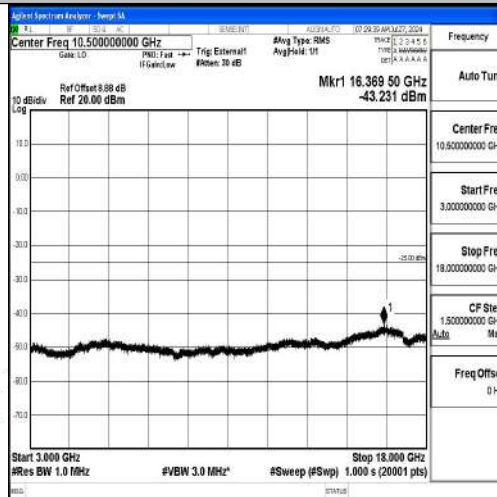

Band41-15MHz-16QAM-39725-1RB#0-3000~18000-PASS

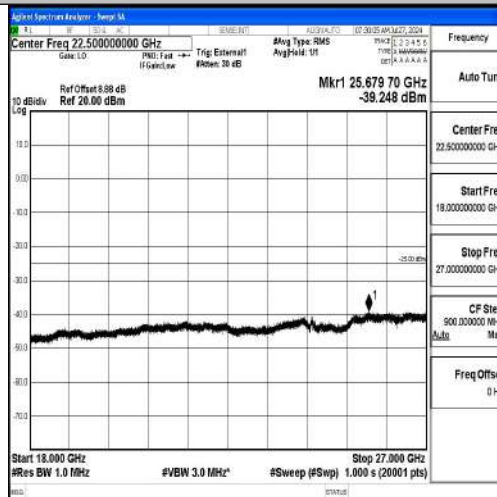

Band41-15MHz-16QAM-39725-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

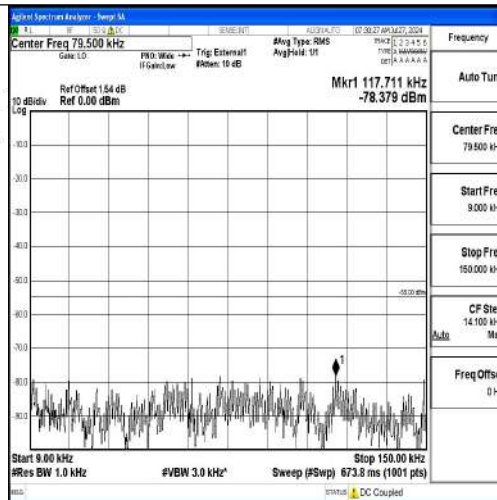

Band41-15MHz-QPSK-40620-1RB#0-0.009~0.15-PASS

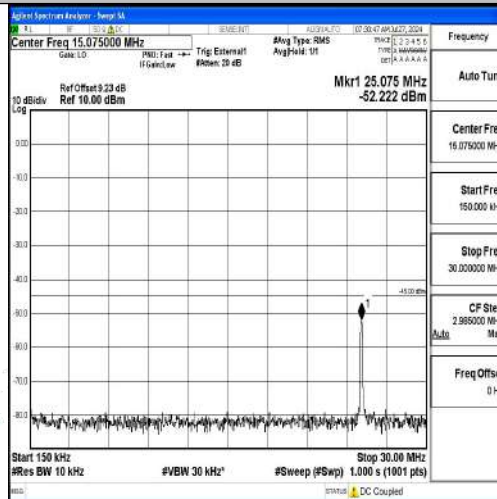

Band41-15MHz-QPSK-40620-1RB#0-0.15~30-PASS

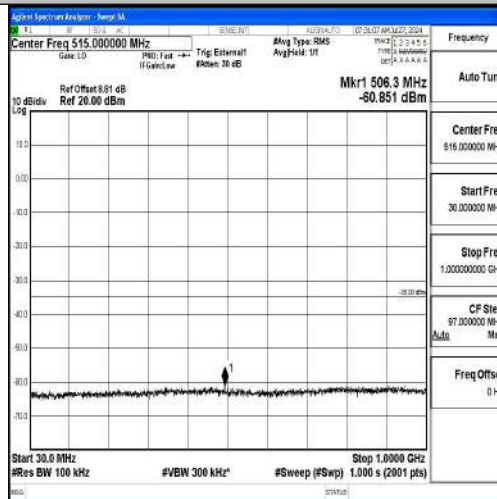

Band41-15MHz-QPSK-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

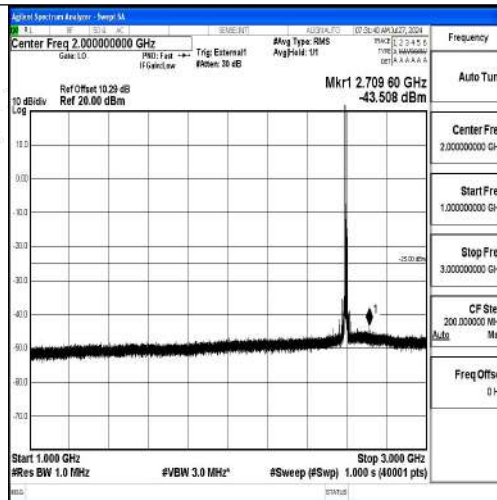

Band41-15MHz-QPSK-40620-1RB#0-1000~3000-PASS

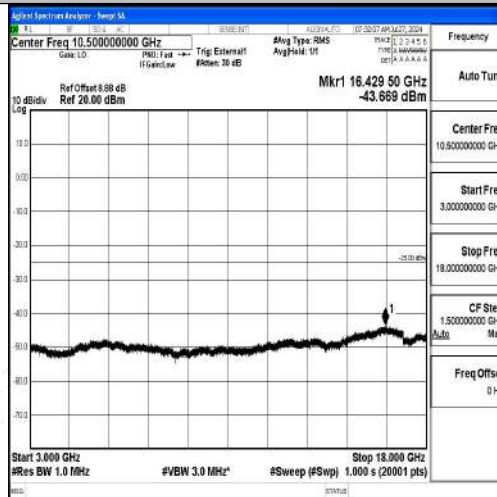

Band41-15MHz-QPSK-40620-1RB#0-3000~18000-PASS

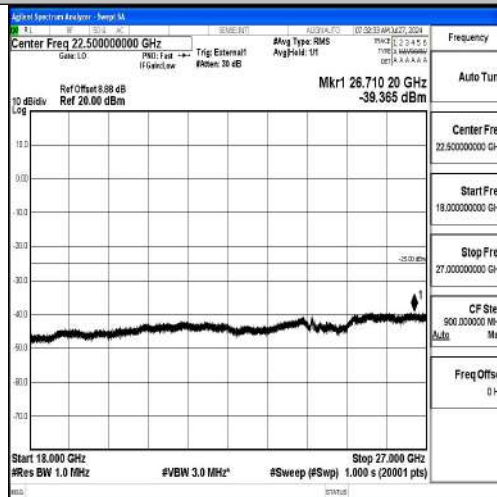

Band41-15MHz-QPSK-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

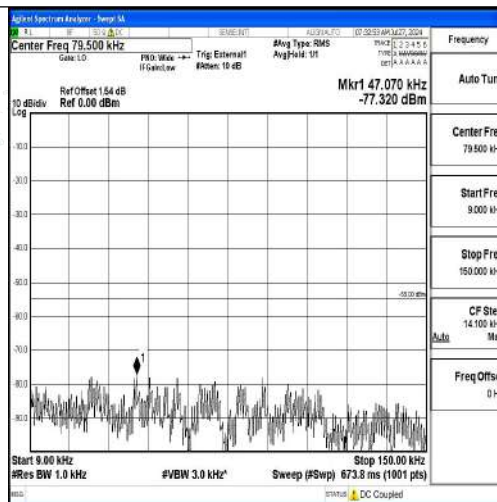

Band41-15MHz-16QAM-40620-1RB#0-0.009~0.15-PASS

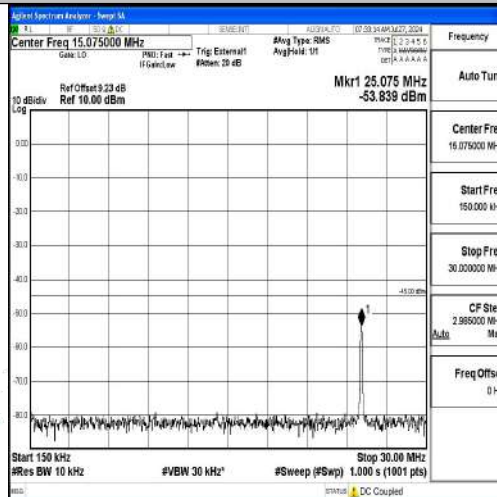

Band41-15MHz-16QAM-40620-1RB#0-0.15~30-PASS

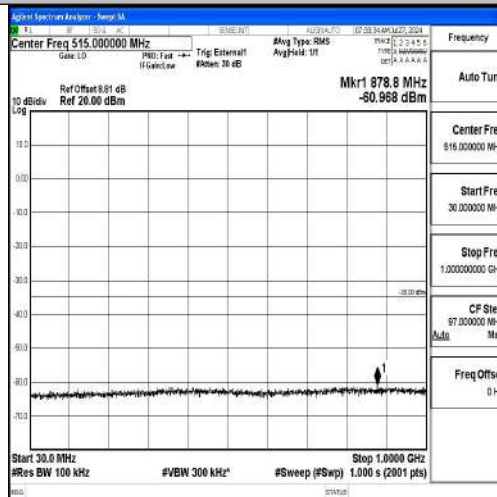

Band41-15MHz-16QAM-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

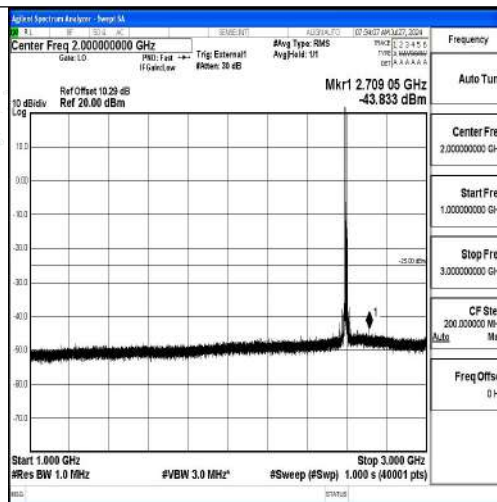

Band41-15MHz-16QAM-40620-1RB#0-1000~3000-PASS

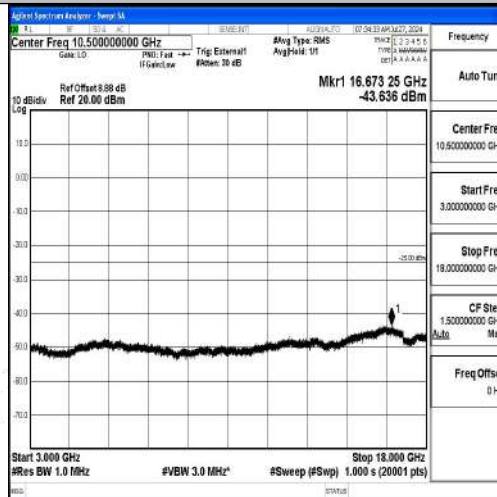

Band41-15MHz-16QAM-40620-1RB#0-3000~18000-PASS

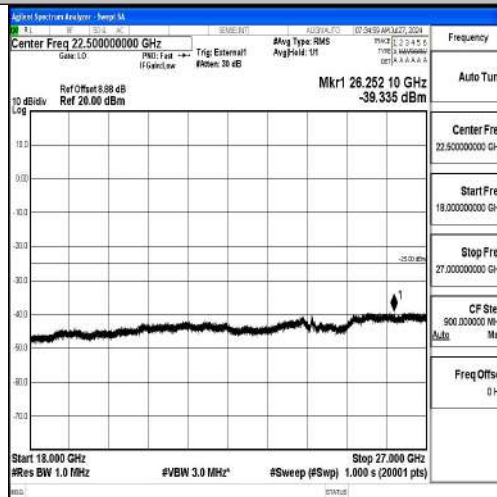

Band41-15MHz-16QAM-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

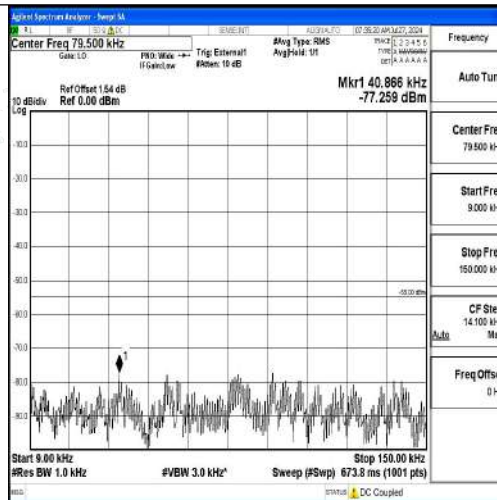

Band41-15MHz-QPSK-41515-1RB#0-0.009~0.15-PASS

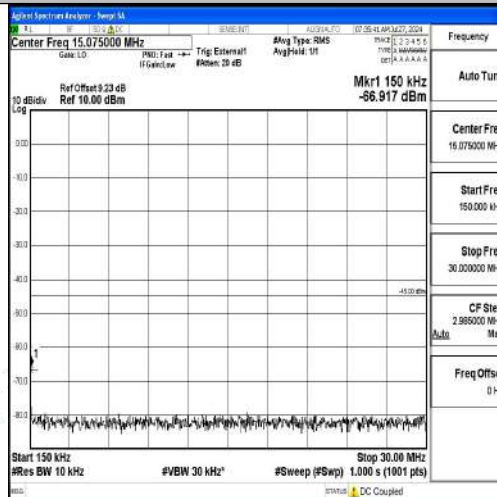

Band41-15MHz-QPSK-41515-1RB#0-0.15~30-PASS

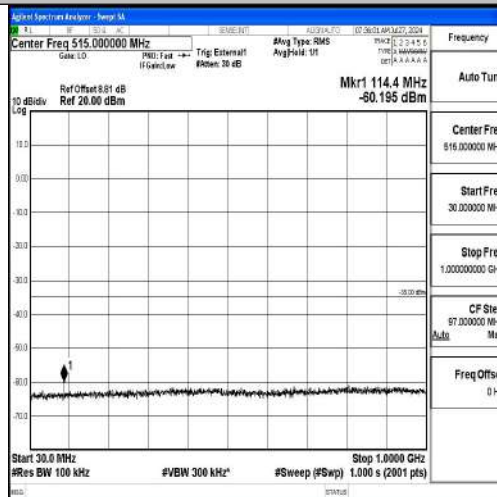

Band41-15MHz-QPSK-41515-1RB#0-30~1000-PASS







Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

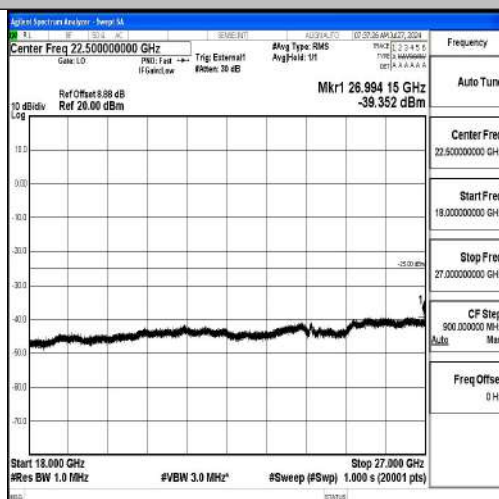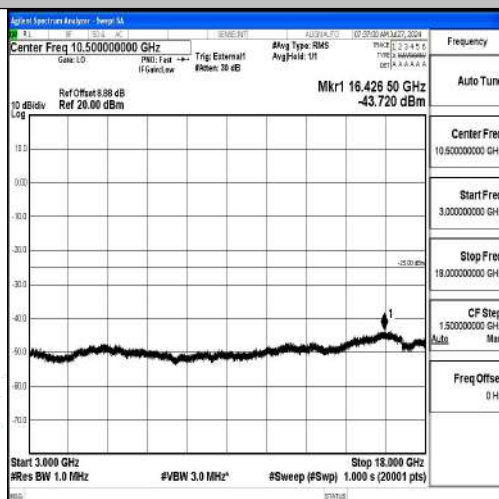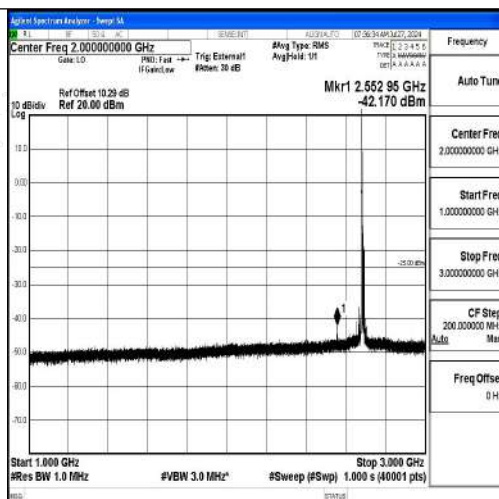


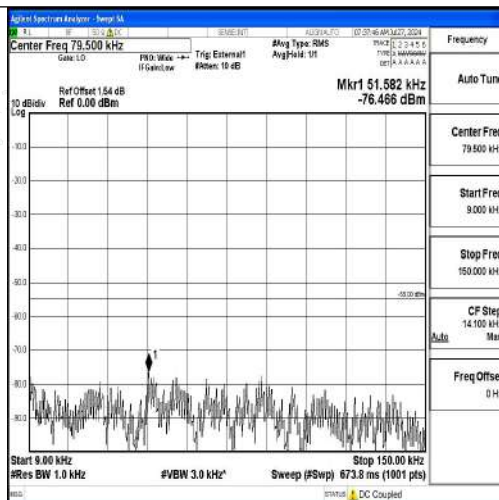

Band41-15MHz-16QAM-41515-1RB#0-0.009~0.15-PASS

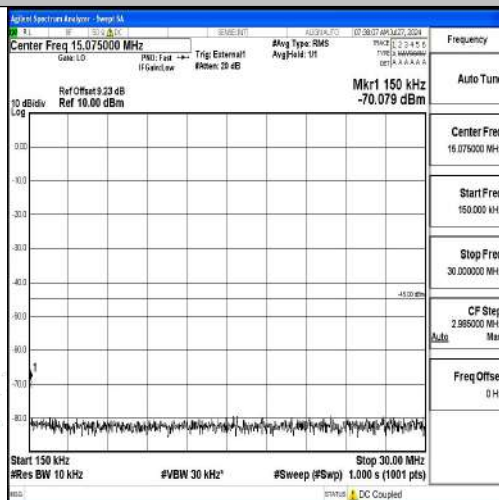

Band41-15MHz-16QAM-41515-1RB#0-0.15~30-PASS

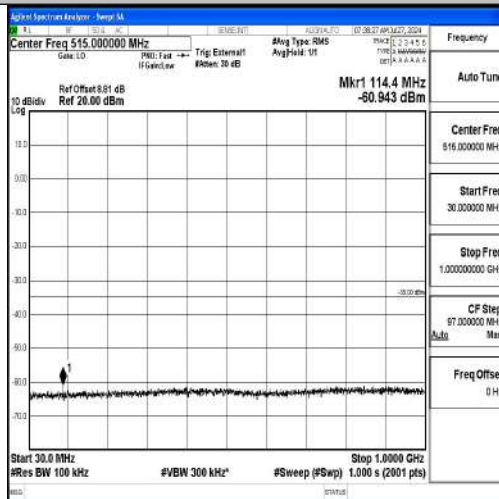

Band41-15MHz-16QAM-41515-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

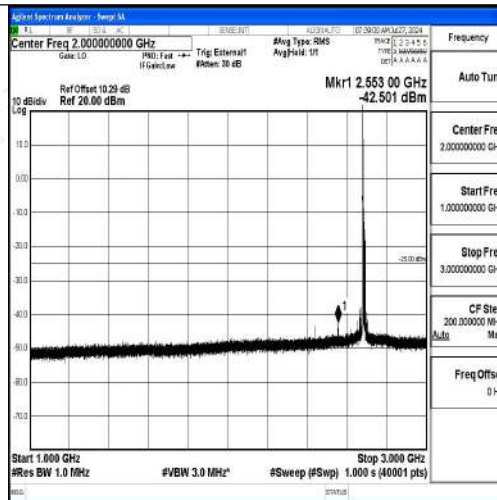

Band41-15MHz-16QAM-41515-1RB#0-1000~3000-PASS

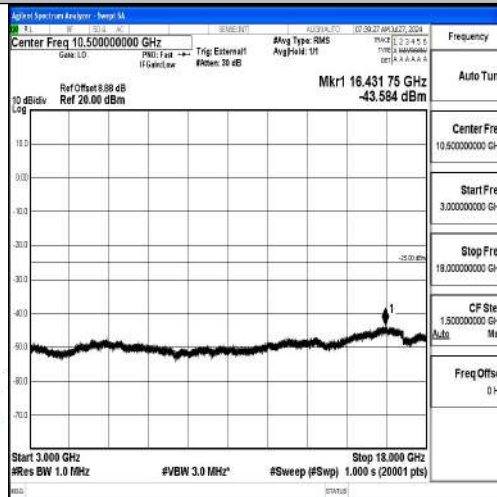

Band41-15MHz-16QAM-41515-1RB#0-3000~18000-PASS

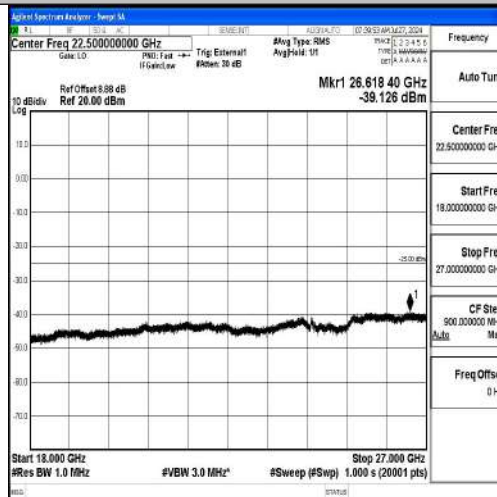

Band41-15MHz-16QAM-41515-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

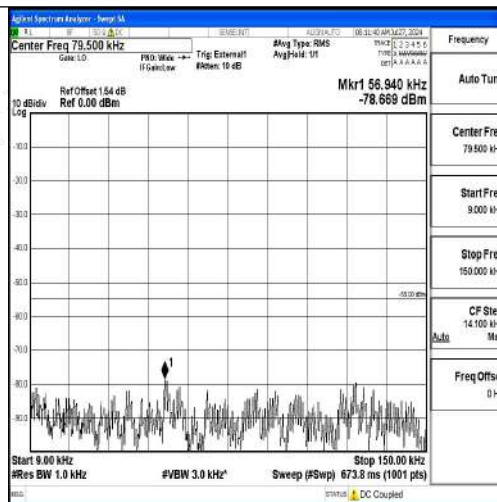

Band41-20MHz-QPSK-39750-1RB#0-0.009~0.15-PASS

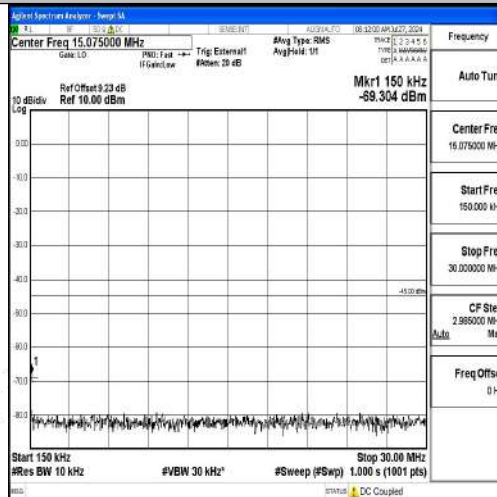

Band41-20MHz-QPSK-39750-1RB#0-0.15~30-PASS

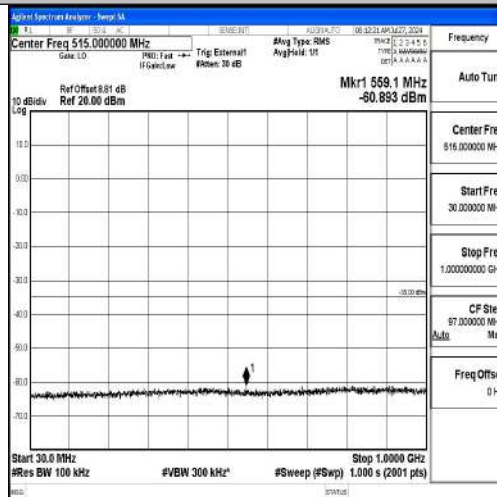

Band41-20MHz-QPSK-39750-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

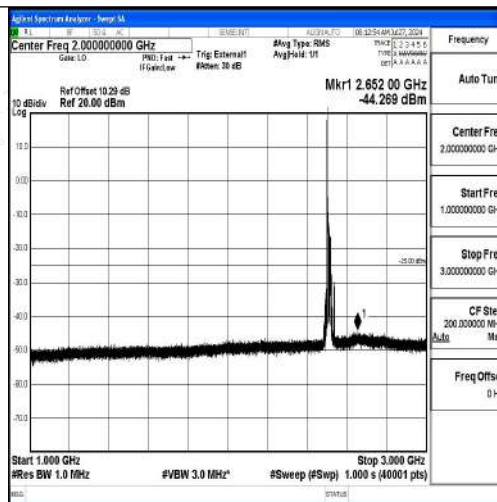

Band41-20MHz-QPSK-39750-1RB#0-1000~3000-PASS

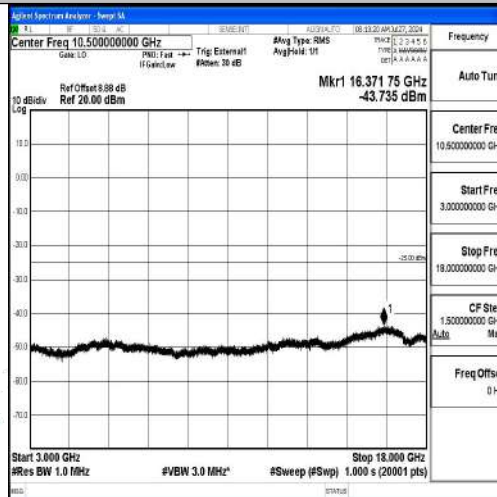

Band41-20MHz-QPSK-39750-1RB#0-3000~18000-PASS

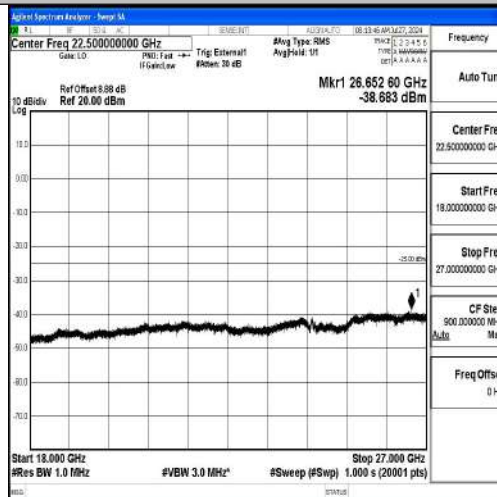

Band41-20MHz-QPSK-39750-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

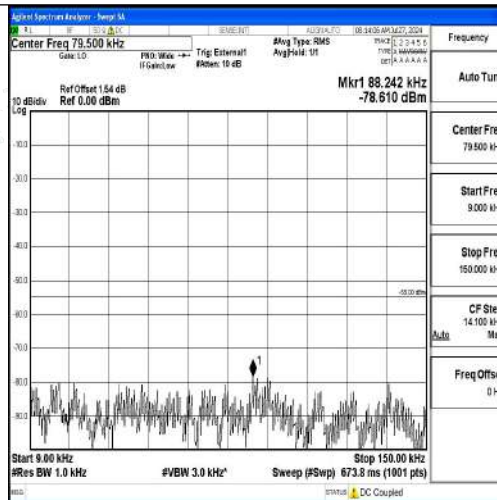

Band41-20MHz-16QAM-39750-1RB#0-0.009~0.15-PASS

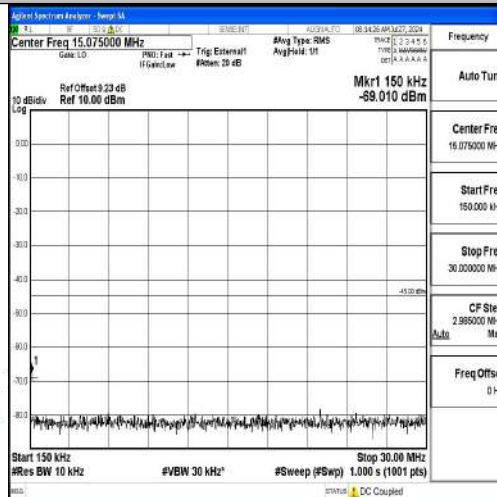

Band41-20MHz-16QAM-39750-1RB#0-0.15~30-PASS

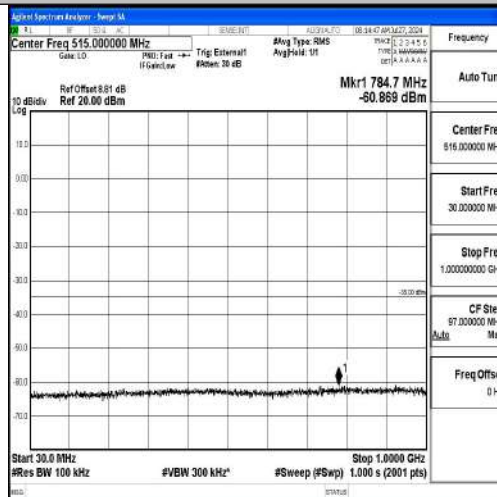

Band41-20MHz-16QAM-39750-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

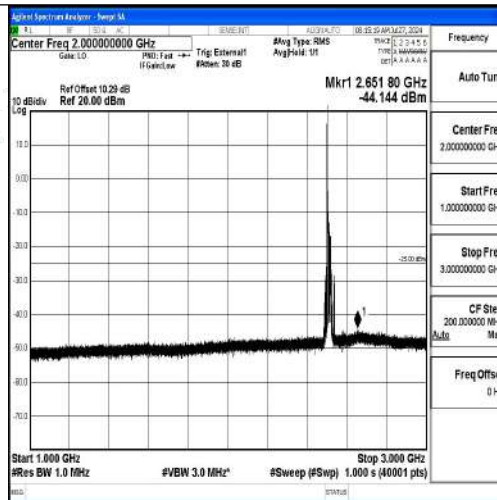

Band41-20MHz-16QAM-39750-1RB#0-1000~3000-PASS

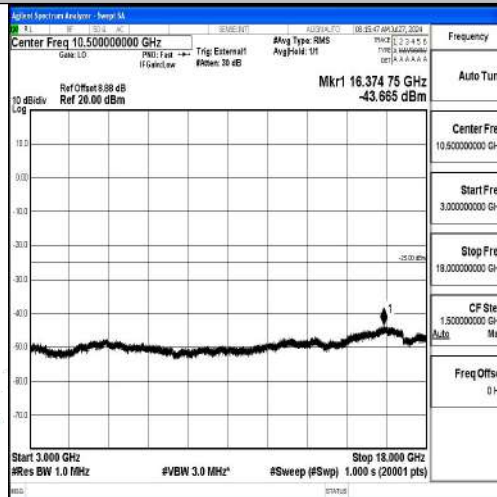

Band41-20MHz-16QAM-39750-1RB#0-3000~18000-PASS

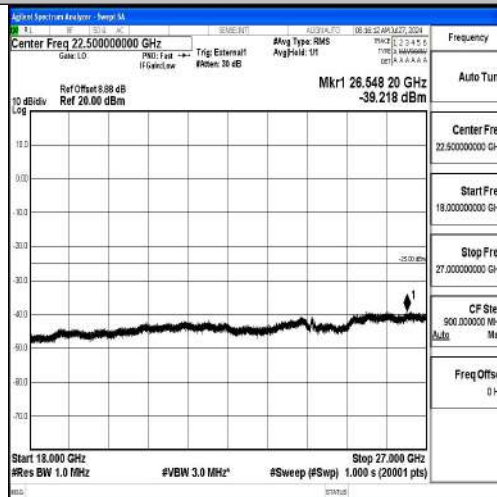

Band41-20MHz-16QAM-39750-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

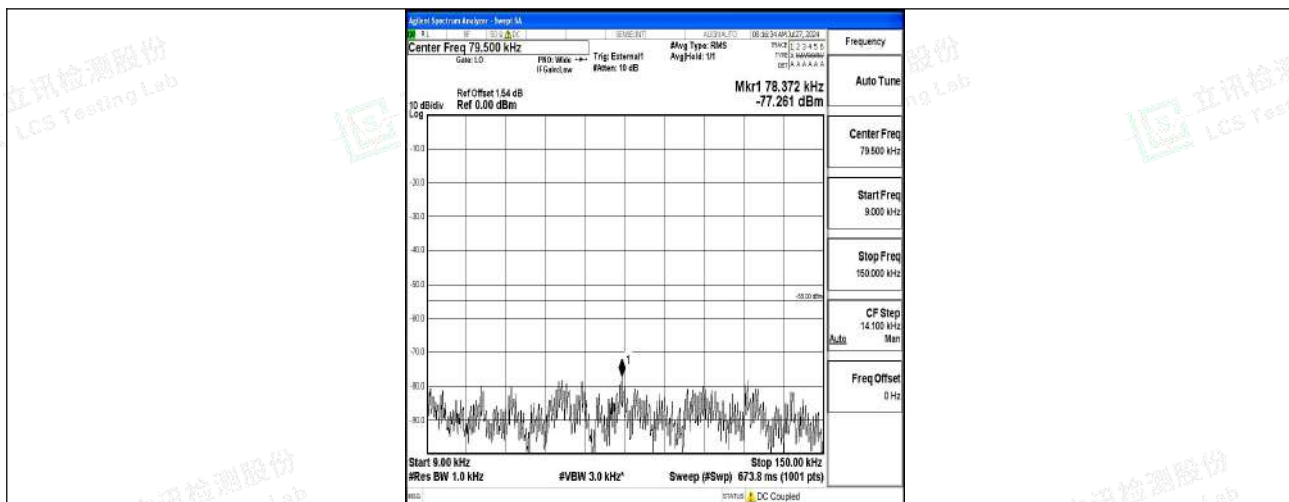

Band41-20MHz-QPSK-40620-1RB#0-0.009~0.15-PASS

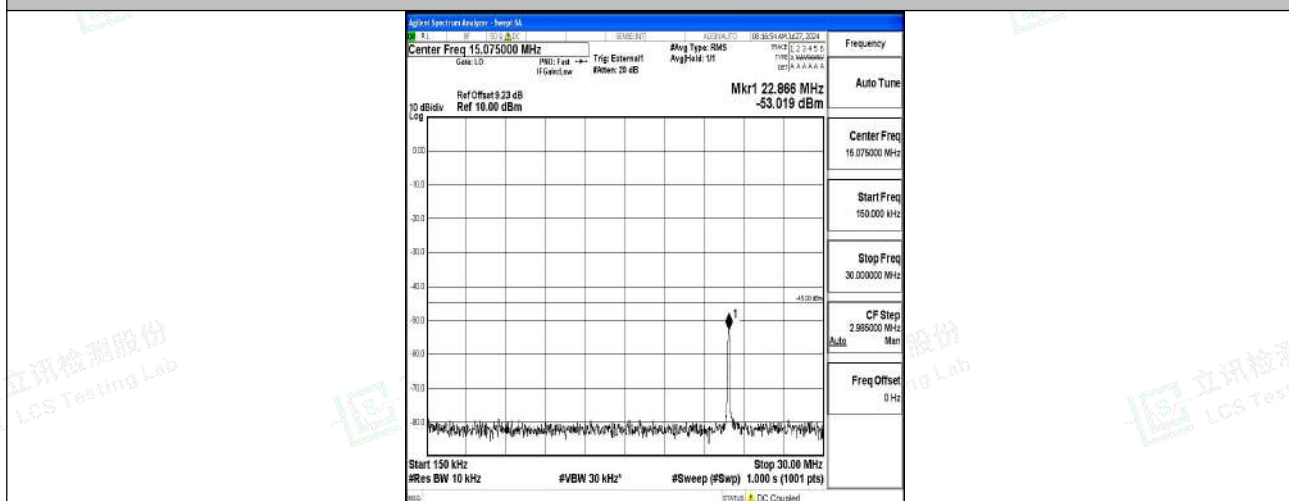


Band41-20MHz-QPSK-40620-1RB#0-0.15~30-PASS

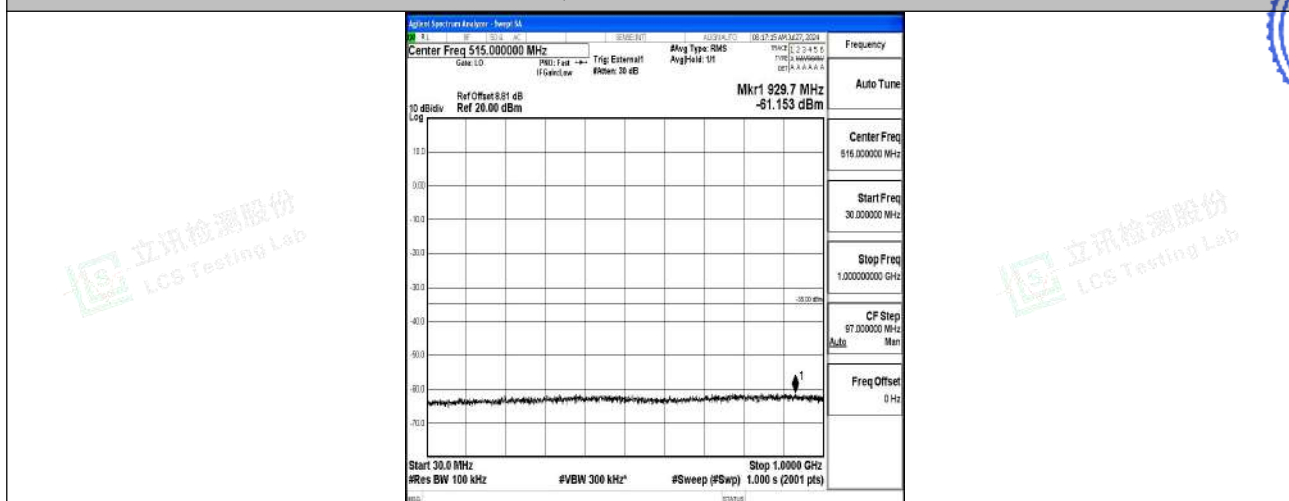


Band41-20MHz-QPSK-40620-1RB#0-30~1000-PASS




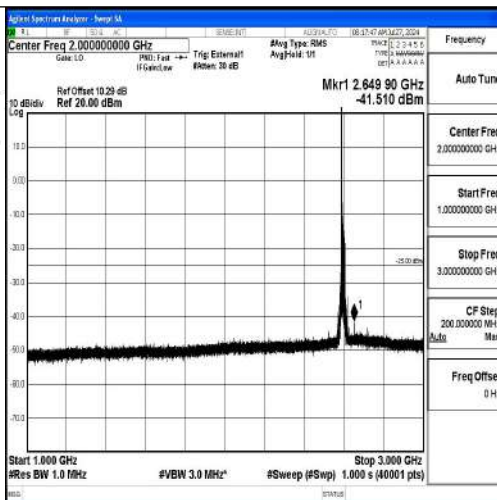

Band41-20MHz-QPSK-40620-1RB#0-1000~3000-PASS

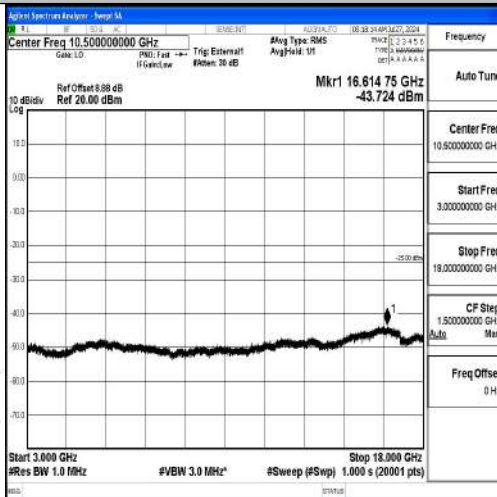

Band41-20MHz-QPSK-40620-1RB#0-3000~18000-PASS

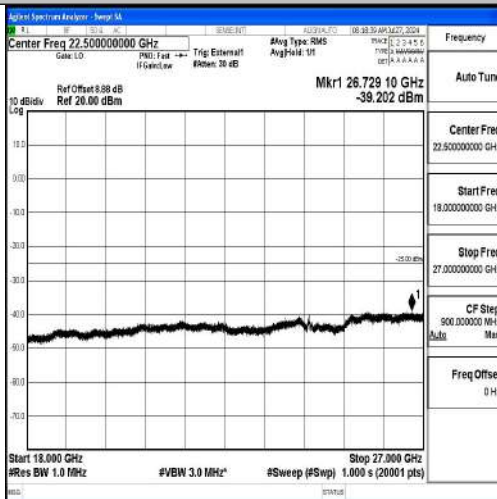

Band41-20MHz-QPSK-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

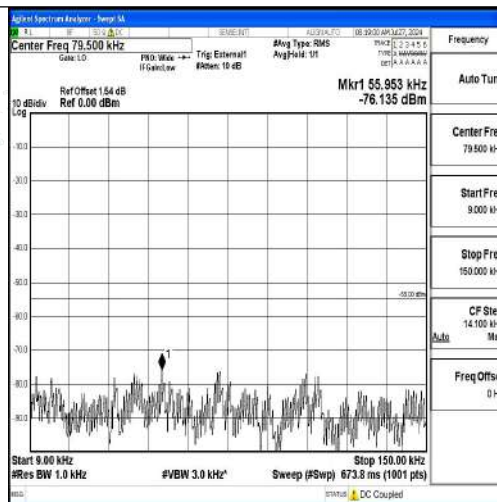

Band41-20MHz-16QAM-40620-1RB#0-0.009~0.15-PASS

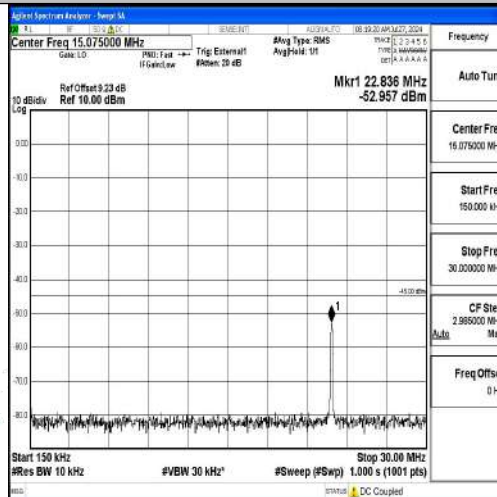

Band41-20MHz-16QAM-40620-1RB#0-0.15~30-PASS

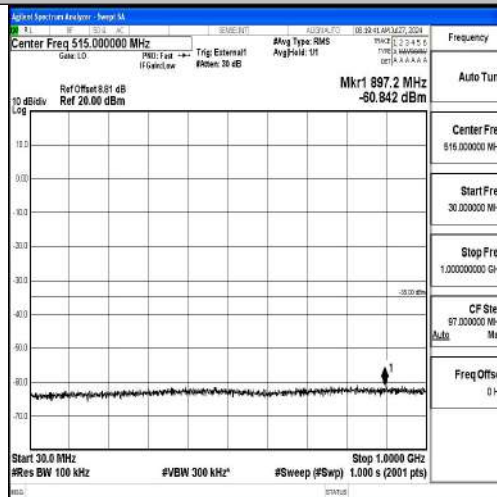

Band41-20MHz-16QAM-40620-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

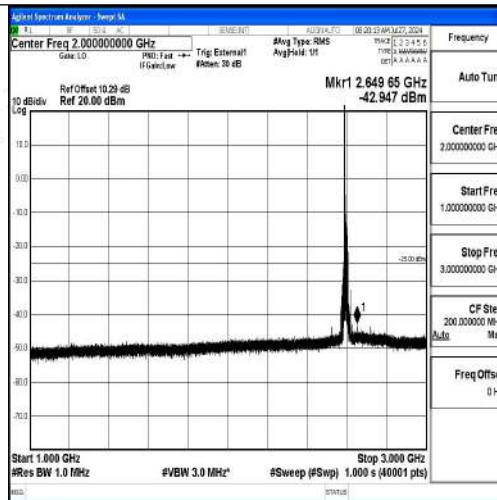

Band41-20MHz-16QAM-40620-1RB#0-1000~3000-PASS

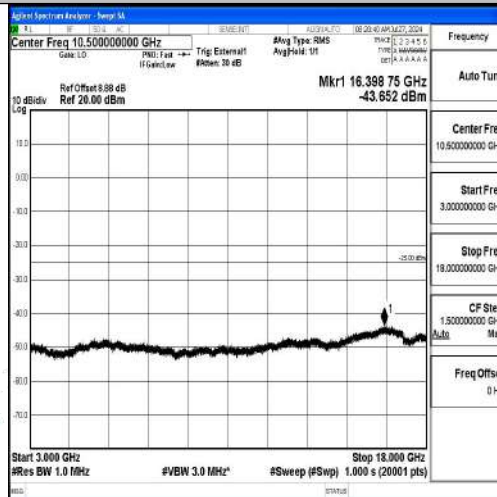

Band41-20MHz-16QAM-40620-1RB#0-3000~18000-PASS

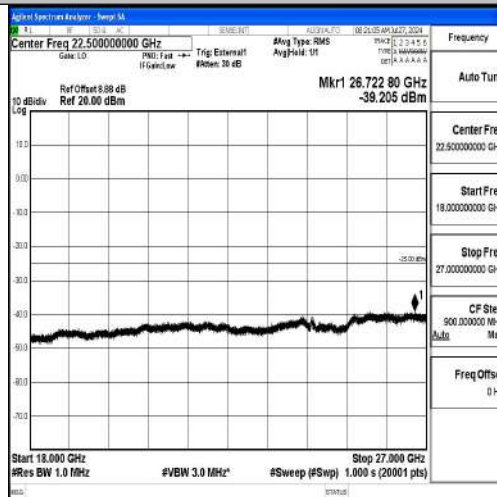

Band41-20MHz-16QAM-40620-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

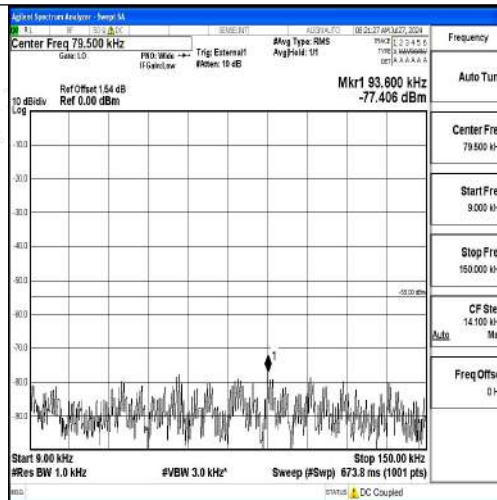

Band41-20MHz-QPSK-41490-1RB#0-0.009~0.15-PASS

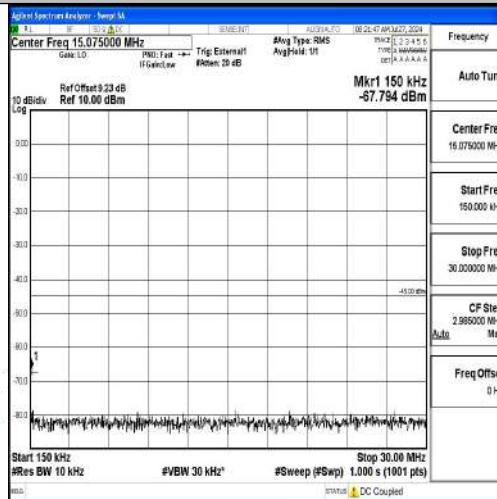

Band41-20MHz-QPSK-41490-1RB#0-0.15~30-PASS

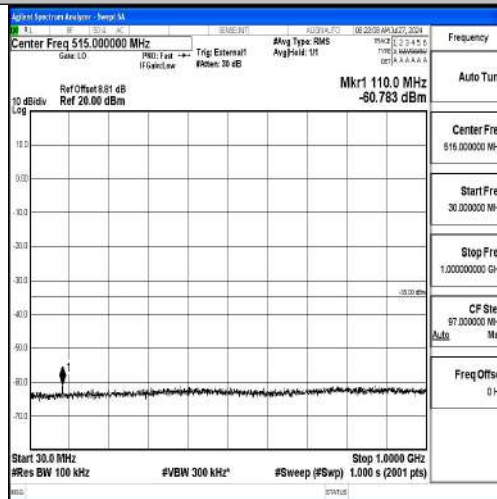

Band41-20MHz-QPSK-41490-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

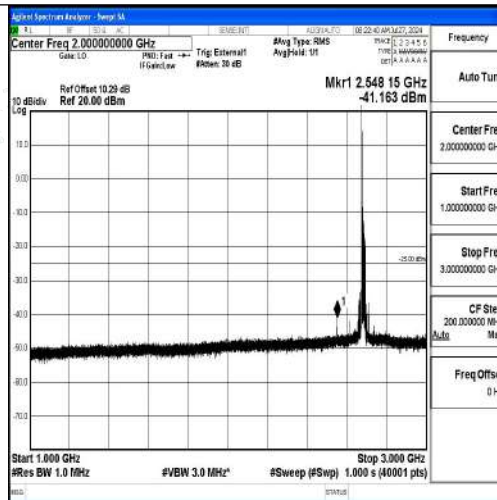

Band41-20MHz-QPSK-41490-1RB#0-1000~3000-PASS

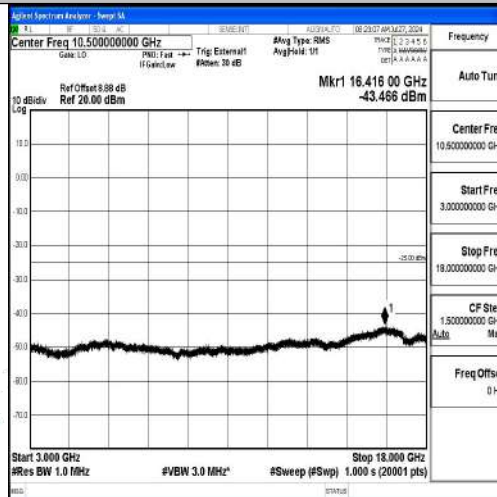

Band41-20MHz-QPSK-41490-1RB#0-3000~18000-PASS

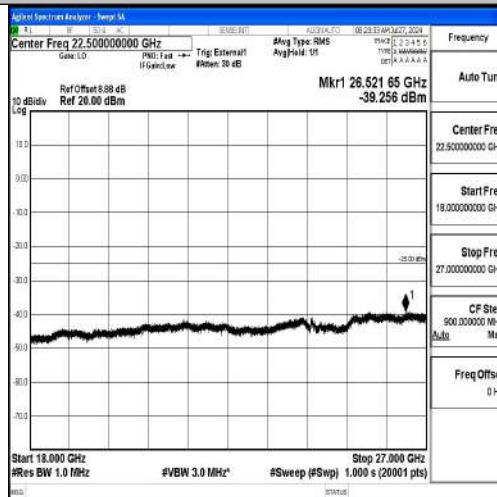

Band41-20MHz-QPSK-41490-1RB#0-18000~27000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

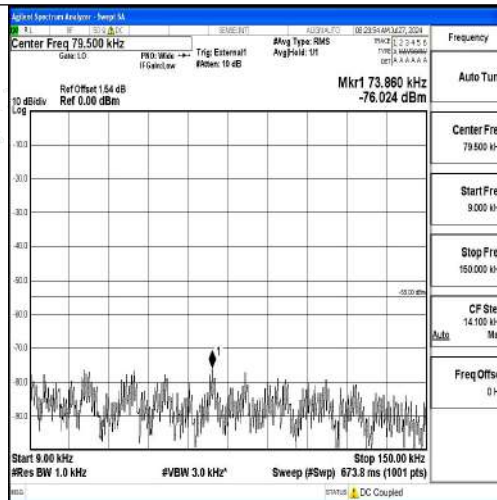

Band41-20MHz-16QAM-41490-1RB#0-0.009~0.15-PASS

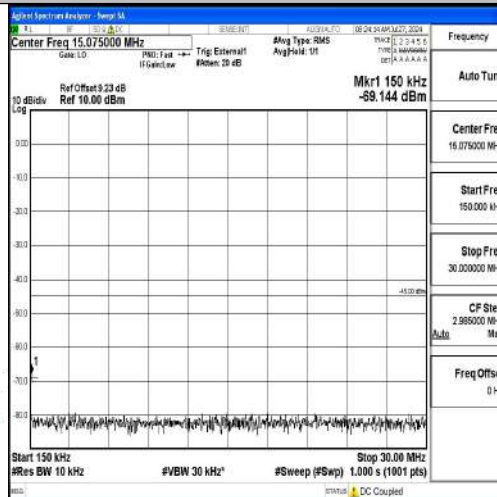

Band41-20MHz-16QAM-41490-1RB#0-0.15~30-PASS

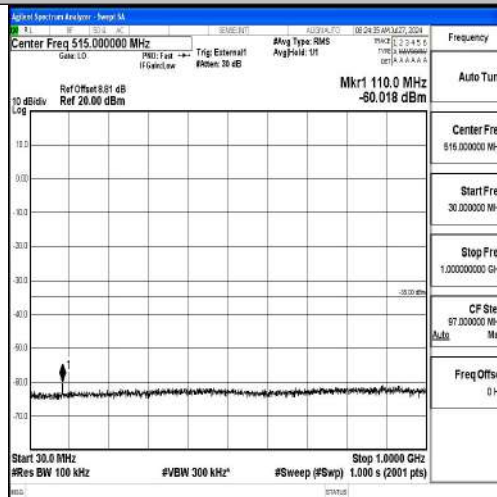

Band41-20MHz-16QAM-41490-1RB#0-30~1000-PASS




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity

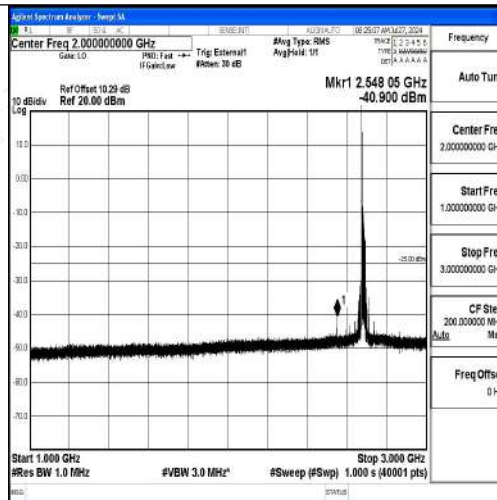

Band41-20MHz-16QAM-41490-1RB#0-1000~3000-PASS

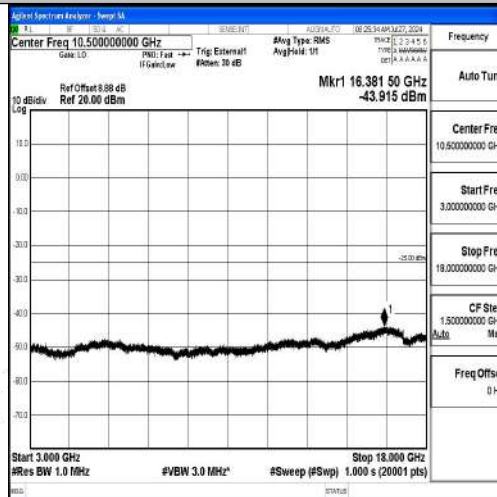

Band41-20MHz-16QAM-41490-1RB#0-3000~18000-PASS

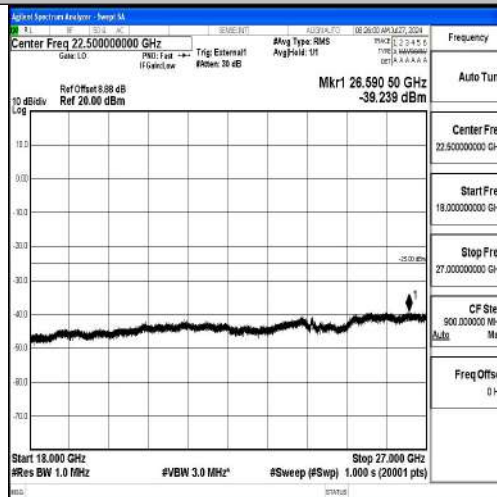

Band41-20MHz-16QAM-41490-1RB#0-18000~27000-PASS



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity