



D.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant1	4500	-47.81	2	-	49.42	Peak	68.2	Pass
NVNT	a	5180	Ant1	4500	-56.82	2	0.24	40.65	Average	54	Pass
NVNT	a	5180	Ant1	5148.9	-39.69	2	-	57.54	Peak	68.2	Pass
NVNT	a	5180	Ant1	5148.9	-52.69	2	0.24	44.78	Average	54	Pass
NVNT	a	5180	Ant1	5150	-40.83	2	-	56.4	Peak	68.2	Pass
NVNT	a	5180	Ant1	5150	-53.83	2	0.24	43.64	Average	54	Pass
NVNT	a	5240	Ant1	5350	-48.18	2	-	49.05	Peak	68.2	Pass
NVNT	a	5240	Ant1	5350	-56.37	2	0.24	41.1	Average	54	Pass
NVNT	a	5240	Ant1	5376	-45.65	2	-	51.58	Peak	68.2	Pass
NVNT	a	5240	Ant1	5351.76	-55.72	2	0.24	41.75	Average	54	Pass
NVNT	a	5240	Ant1	5460	-50.36	2	-	46.87	Peak	68.2	Pass
NVNT	a	5240	Ant1	5460	-56.8	2	0.24	40.67	Average	54	Pass
NVNT	n20	5180	Ant1	4500	-48.93	2	-	48.3	Peak	68.2	Pass
NVNT	n20	5180	Ant1	4500	-57.56	2	0.28	39.95	Average	54	Pass
NVNT	n20	5180	Ant1	5148.2	-41.22	2	-	56.01	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5148.2	-52.89	2	0.28	44.62	Average	54	Pass
NVNT	n20	5180	Ant1	5150	-37.4	2	-	59.83	Peak	68.2	Pass
NVNT	n20	5180	Ant1	5150	-52.68	2	0.28	44.83	Average	54	Pass
NVNT	n20	5240	Ant1	5350	-47.44	2	-	49.79	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350	-56.29	2	0.28	41.22	Average	54	Pass
NVNT	n20	5240	Ant1	5454	-45.75	2	-	51.48	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5350.56	-55.8	2	0.28	41.71	Average	54	Pass
NVNT	n20	5240	Ant1	5460	-49.51	2	-	47.72	Peak	68.2	Pass
NVNT	n20	5240	Ant1	5460	-57.16	2	0.28	40.35	Average	54	Pass
NVNT	n40	5190	Ant1	4500	-48.75	2	-	48.48	Peak	68.2	Pass
NVNT	n40	5190	Ant1	4500	-57.64	2	0.12	39.71	Average	54	Pass
NVNT	n40	5190	Ant1	5148.24	-43.13	2	-	54.1	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5149.7	-53.23	2	0.12	44.12	Average	54	Pass
NVNT	n40	5190	Ant1	5150	-43.51	2	-	53.72	Peak	68.2	Pass
NVNT	n40	5190	Ant1	5150	-53.23	2	0.12	44.12	Average	54	Pass
NVNT	n40	5230	Ant1	5350	-47.95	2	-	49.28	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350	-56.32	2	0.12	41.03	Average	54	Pass
NVNT	n40	5230	Ant1	5381.16	-46.3	2	-	50.93	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5350.65	-55.99	2	0.12	41.36	Average	54	Pass
NVNT	n40	5230	Ant1	5460	-48.58	2	-	48.65	Peak	68.2	Pass
NVNT	n40	5230	Ant1	5460	-57.35	2	0.12	40	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant1	4500	-48.21	2	-	49.02	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	4500	-57.47	2	0.28	40.04	Average	54	Pass
NVNT	ac20	5180	Ant1	5149.6	-40.64	2	-	56.59	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5148.9	-53.27	2	0.28	44.24	Average	54	Pass
NVNT	ac20	5180	Ant1	5150	-43.39	2	-	53.84	Peak	68.2	Pass
NVNT	ac20	5180	Ant1	5150	-53.22	2	0.28	44.29	Average	54	Pass
NVNT	ac20	5240	Ant1	5350	-48.06	2	-	49.17	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350	-55.94	2	0.28	41.57	Average	54	Pass
NVNT	ac20	5240	Ant1	5419.2	-45.83	2	-	51.4	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5350.08	-55.94	2	0.28	41.57	Average	54	Pass
NVNT	ac20	5240	Ant1	5460	-47.4	2	-	49.83	Peak	68.2	Pass
NVNT	ac20	5240	Ant1	5460	-57.4	2	0.28	40.11	Average	54	Pass
NVNT	ac40	5190	Ant1	4500	-50.41	2	-	46.82	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	4500	-57.35	2	0.12	40	Average	54	Pass
NVNT	ac40	5190	Ant1	5148.97	-43.74	2	-	53.49	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5149.7	-53.61	2	0.12	43.74	Average	54	Pass
NVNT	ac40	5190	Ant1	5150	-44.9	2	-	52.33	Peak	68.2	Pass
NVNT	ac40	5190	Ant1	5150	-53.61	2	0.12	43.74	Average	54	Pass
NVNT	ac40	5230	Ant1	5350	-49.22	2	-	48.01	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5350	-56.89	2	0.12	40.46	Average	54	Pass
NVNT	ac40	5230	Ant1	5407.35	-45.82	2	-	51.41	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5374.95	-56.11	2	0.12	41.24	Average	54	Pass
NVNT	ac40	5230	Ant1	5460	-48.57	2	-	48.66	Peak	68.2	Pass
NVNT	ac40	5230	Ant1	5460	-57.49	2	0.12	39.86	Average	54	Pass
NVNT	ac80	5210	Ant1	5350	-47.11	2	-	50.12	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5350	-55.73	2	0.25	41.75	Average	54	Pass
NVNT	ac80	5210	Ant1	5453.07	-45.04	2	-	52.19	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5354.07	-55.35	2	0.25	42.13	Average	54	Pass
NVNT	ac80	5210	Ant1	5460	-48.09	2	-	49.14	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5460	-56.31	2	0.25	41.17	Average	54	Pass
NVNT	ac80	5210	Ant1	4500	-49.75	2	-	47.48	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	4500	-57.36	2	0.25	40.12	Average	54	Pass
NVNT	ac80	5210	Ant1	5143.85	-41.67	2	-	55.56	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5146.22	-51.78	2	0.25	45.7	Average	54	Pass
NVNT	ac80	5210	Ant1	5150	-43.02	2	-	54.21	Peak	68.2	Pass
NVNT	ac80	5210	Ant1	5150	-51.77	2	0.25	45.71	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5180	Ant2	4500	-49.36	2	-	47.87	Peak	68.2	Pass
NVNT	a	5180	Ant2	4500	-57.07	2	0.24	40.4	Average	54	Pass
NVNT	a	5180	Ant2	5149.6	-38.06	2	-	59.17	Peak	68.2	Pass
NVNT	a	5180	Ant2	5149.6	-49.46	2	0.24	48.01	Average	54	Pass
NVNT	a	5180	Ant2	5150	-39.45	2	-	57.78	Peak	68.2	Pass
NVNT	a	5180	Ant2	5150	-50.03	2	0.24	47.44	Average	54	Pass
NVNT	a	5240	Ant2	5350	-47.53	2	-	49.7	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350	-56.06	2	0.24	41.41	Average	54	Pass
NVNT	a	5240	Ant2	5376.48	-45.45	2	-	51.78	Peak	68.2	Pass
NVNT	a	5240	Ant2	5350.32	-55.54	2	0.24	41.93	Average	54	Pass
NVNT	a	5240	Ant2	5460	-49.23	2	-	48	Peak	68.2	Pass
NVNT	a	5240	Ant2	5460	-57.11	2	0.24	40.36	Average	54	Pass
NVNT	n20	5180	Ant2	4500	-49.65	2	-	47.58	Peak	68.2	Pass
NVNT	n20	5180	Ant2	4500	-57.36	2	0.28	40.15	Average	54	Pass
NVNT	n20	5180	Ant2	5149.6	-36.47	2	-	60.76	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5148.9	-50.15	2	0.28	47.36	Average	54	Pass
NVNT	n20	5180	Ant2	5150	-35	2	-	62.23	Peak	68.2	Pass
NVNT	n20	5180	Ant2	5150	-49.18	2	0.28	48.33	Average	54	Pass
NVNT	n20	5240	Ant2	5350	-48.37	2	-	48.86	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5350	-56.52	2	0.28	40.99	Average	54	Pass
NVNT	n20	5240	Ant2	5405.04	-45.18	2	-	52.05	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5352.24	-56.18	2	0.28	41.33	Average	54	Pass
NVNT	n20	5240	Ant2	5460	-50.03	2	-	47.2	Peak	68.2	Pass
NVNT	n20	5240	Ant2	5460	-57	2	0.28	40.51	Average	54	Pass
NVNT	n40	5190	Ant2	4500	-49.94	2	-	47.29	Peak	68.2	Pass
NVNT	n40	5190	Ant2	4500	-57.48	2	0.44	40.19	Average	54	Pass
NVNT	n40	5190	Ant2	5145.32	-34.13	2	-	63.1	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5149.7	-48.68	2	0.44	48.99	Average	54	Pass
NVNT	n40	5190	Ant2	5150	-37.35	2	-	59.88	Peak	68.2	Pass
NVNT	n40	5190	Ant2	5150	-48.68	2	0.44	48.99	Average	54	Pass
NVNT	n40	5230	Ant2	5350	-48.02	2	-	49.21	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5350	-56.63	2	0.45	41.05	Average	54	Pass
NVNT	n40	5230	Ant2	5440.29	-46.25	2	-	50.98	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5425.71	-56.13	2	0.45	41.55	Average	54	Pass
NVNT	n40	5230	Ant2	5460	-48.43	2	-	48.8	Peak	68.2	Pass
NVNT	n40	5230	Ant2	5460	-56.69	2	0.45	40.99	Average	54	Pass
NVNT	ac20	5180	Ant2	4500	-49	2	-	48.23	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5180	Ant2	4500	-57.41	2	0.28	40.1	Average	54	Pass
NVNT	ac20	5180	Ant2	5149.6	-38.35	2	-	58.88	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5149.6	-50.54	2	0.28	46.97	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-39.04	2	-	58.19	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-50.49	2	0.28	47.02	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-48.3	2	-	48.93	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-56.56	2	0.28	40.95	Average	54	Pass
NVNT	ac20	5240	Ant2	5374.8	-46.48	2	-	50.75	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5362.56	-56.26	2	0.28	41.25	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-49.06	2	-	48.17	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.52	2	0.28	39.99	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-48.05	2	-	49.18	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-57.52	2	0.45	40.16	Average	54	Pass
NVNT	ac40	5190	Ant2	5148.97	-37.28	2	-	59.95	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5149.7	-48.84	2	0.45	48.84	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-39.18	2	-	58.05	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-48.84	2	0.45	48.84	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-48.15	2	-	49.08	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-56.98	2	0.44	40.69	Average	54	Pass
NVNT	ac40	5230	Ant2	5354.16	-46.59	2	-	50.64	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5400.6	-56.16	2	0.44	41.51	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-48.6	2	-	48.63	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-56.86	2	0.44	40.81	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-47.03	2	-	50.2	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-55.68	2	0.62	42.17	Average	54	Pass
NVNT	ac80	5210	Ant2	5351.76	-45.1	2	-	52.13	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5369.25	-55.63	2	0.62	42.22	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-49.37	2	-	47.86	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.75	2	0.62	41.1	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-50.14	2	-	47.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-56.89	2	0.62	40.96	Average	54	Pass
NVNT	ac80	5210	Ant2	5144.64	-41.27	2	-	55.96	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5142.27	-51.14	2	0.62	46.71	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-41	2	-	56.23	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-51.54	2	0.62	46.31	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT1 Power (dBm)	ANT2 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	4500	-48.93	-49.65	4.64	53.60	Peak	68.2	Pass
NVNT	n20	5180	4500	-57.56	-57.36	4.64	45.42	Average	54	Pass
NVNT	n20	5180	5149.6	-41.22	-36.47	4.64	64.65	Peak	68.2	Pass
NVNT	n20	5180	5148.2	-52.89	-50.15	4.64	51.57	Average	54	Pass
NVNT	n20	5180	5150	-37.4	-35	4.64	66.84	Peak	68.2	Pass
NVNT	n20	5180	5150	-52.68	-49.18	4.64	52.29	Average	54	Pass
NVNT	n20	5240	5350	-47.44	-48.37	4.64	55.00	Peak	68.2	Pass
NVNT	n20	5240	5350	-56.29	-56.52	4.64	46.47	Average	54	Pass
NVNT	n20	5240	5356.08	-45.75	-45.18	4.64	57.42	Peak	68.2	Pass
NVNT	n20	5240	5351.52	-55.8	-56.18	4.64	46.89	Average	54	Pass
NVNT	n20	5240	5460	-49.51	-50.03	4.64	53.12	Peak	68.2	Pass
NVNT	n20	5240	5460	-57.16	-57	4.64	45.80	Average	54	Pass
NVNT	n40	5190	4500	-48.75	-49.94	4.64	53.57	Peak	68.2	Pass
NVNT	n40	5190	4500	-57.64	-57.48	4.64	45.32	Average	54	Pass
NVNT	n40	5190	5149.7	-43.13	-34.13	4.64	66.25	Peak	68.2	Pass
NVNT	n40	5190	5149.7	-53.23	-48.68	4.64	52.49	Average	54	Pass
NVNT	n40	5190	5150	-43.51	-37.35	4.64	63.46	Peak	68.2	Pass
NVNT	n40	5190	5150	-53.23	-48.68	4.64	52.49	Average	54	Pass
NVNT	n40	5230	5350	-47.95	-48.02	4.64	54.89	Peak	68.2	Pass
NVNT	n40	5230	5350	-56.32	-56.63	4.64	46.41	Average	54	Pass
NVNT	n40	5230	5419.23	-46.3	-46.25	4.64	56.60	Peak	68.2	Pass
NVNT	n40	5230	5447.04	-55.99	-56.13	4.64	46.82	Average	54	Pass
NVNT	n40	5230	5460	-48.58	-48.43	4.64	54.37	Peak	68.2	Pass
NVNT	n40	5230	5460	-57.35	-56.69	4.64	45.87	Average	54	Pass
NVNT	ac20	5180	4500	-48.21	-49	4.64	54.29	Peak	68.2	Pass
NVNT	ac20	5180	4500	-57.47	-57.41	4.64	45.44	Average	54	Pass
NVNT	ac20	5180	5149.6	-40.64	-38.35	4.64	63.53	Peak	68.2	Pass
NVNT	ac20	5180	5148.9	-53.27	-50.54	4.64	51.18	Average	54	Pass
NVNT	ac20	5180	5150	-43.39	-39.04	4.64	62.19	Peak	68.2	Pass
NVNT	ac20	5180	5150	-53.22	-50.49	4.64	51.23	Average	54	Pass
NVNT	ac20	5240	5350	-48.06	-48.3	4.64	54.70	Peak	68.2	Pass
NVNT	ac20	5240	5350	-55.94	-56.56	4.64	46.64	Average	54	Pass
NVNT	ac20	5240	5442	-45.83	-46.48	4.64	56.74	Peak	68.2	Pass
NVNT	ac20	5240	5350.32	-55.94	-56.26	4.64	46.78	Average	54	Pass
NVNT	ac20	5240	5460	-47.4	-49.06	4.64	54.73	Peak	68.2	Pass
NVNT	ac20	5240	5460	-57.4	-57.52	4.64	45.42	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	4500	-50.41	-48.05	4.64	53.81	Peak	68.2	Pass
NVNT	ac40	5190	4500	-57.35	-57.52	4.64	45.44	Average	54	Pass
NVNT	ac40	5190	5149.7	-43.74	-37.28	4.64	63.47	Peak	68.2	Pass
NVNT	ac40	5190	5148.97	-53.61	-48.84	4.64	52.28	Average	54	Pass
NVNT	ac40	5190	5150	-44.9	-39.18	4.64	61.72	Peak	68.2	Pass
NVNT	ac40	5190	5150	-53.61	-48.84	4.64	52.28	Average	54	Pass
NVNT	ac40	5230	5350	-49.22	-48.15	4.64	54.23	Peak	68.2	Pass
NVNT	ac40	5230	5350	-56.89	-56.98	4.64	45.94	Average	54	Pass
NVNT	ac40	5230	5357.67	-45.82	-46.59	4.64	56.69	Peak	68.2	Pass
NVNT	ac40	5230	5403.3	-56.11	-56.16	4.64	46.74	Average	54	Pass
NVNT	ac40	5230	5460	-48.57	-48.6	4.64	54.29	Peak	68.2	Pass
NVNT	ac40	5230	5460	-57.49	-56.86	4.64	45.71	Average	54	Pass
NVNT	ac80	5210	5350	-47.11	-47.03	4.64	55.81	Peak	68.2	Pass
NVNT	ac80	5210	5350	-55.73	-55.68	4.64	47.17	Average	54	Pass
NVNT	ac80	5210	5393.34	-45.04	-45.1	4.64	57.81	Peak	68.2	Pass
NVNT	ac80	5210	5420.4	-55.35	-55.63	4.64	47.39	Average	54	Pass
NVNT	ac80	5210	5460	-48.09	-49.37	4.64	54.19	Peak	68.2	Pass
NVNT	ac80	5210	5460	-56.31	-56.75	4.64	46.35	Average	54	Pass
NVNT	ac80	5210	4500	-49.75	-50.14	4.64	52.94	Peak	68.2	Pass
NVNT	ac80	5210	4500	-57.36	-56.89	4.64	45.76	Average	54	Pass
NVNT	ac80	5210	5140.69	-41.67	-41.27	4.64	61.41	Peak	68.2	Pass
NVNT	ac80	5210	5137.53	-51.78	-51.14	4.64	51.43	Average	54	Pass
NVNT	ac80	5210	5150	-43.02	-41	4.64	60.98	Peak	68.2	Pass
NVNT	ac80	5210	5150	-51.77	-51.54	4.64	51.22	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant1 Peak

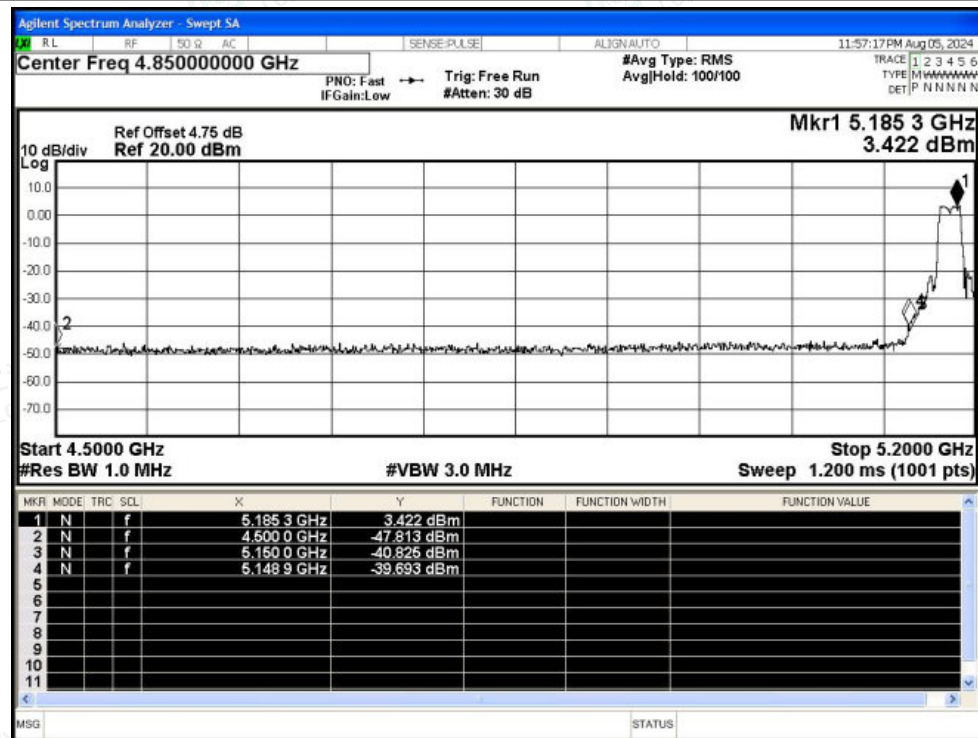

Restrict Band NVNT a 5180MHz Ant1 Average

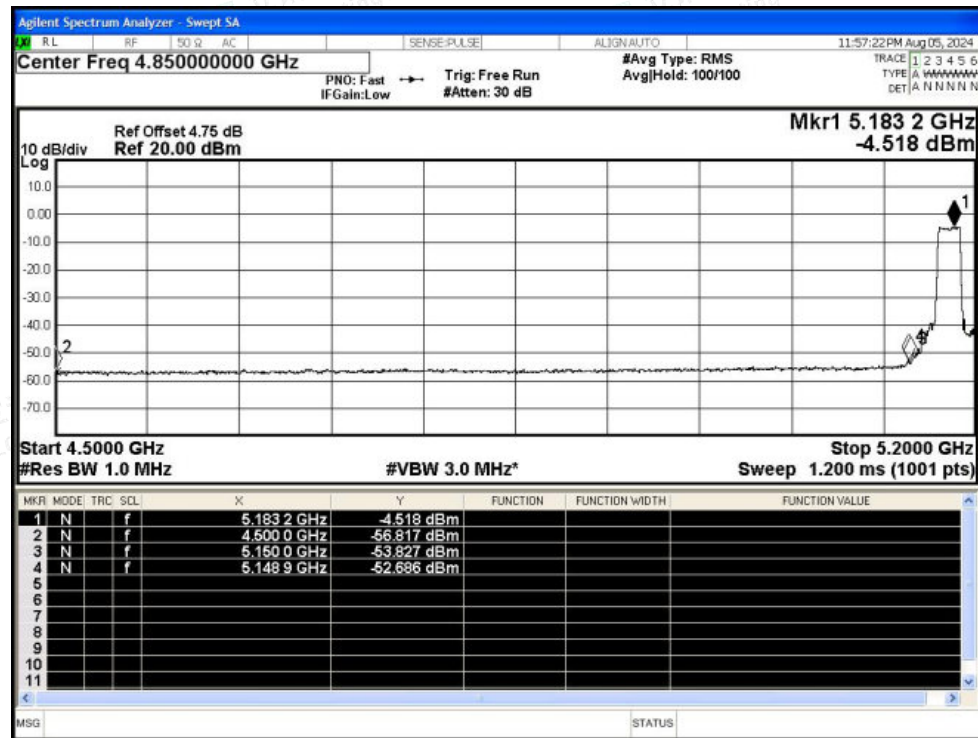

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant1 Peak

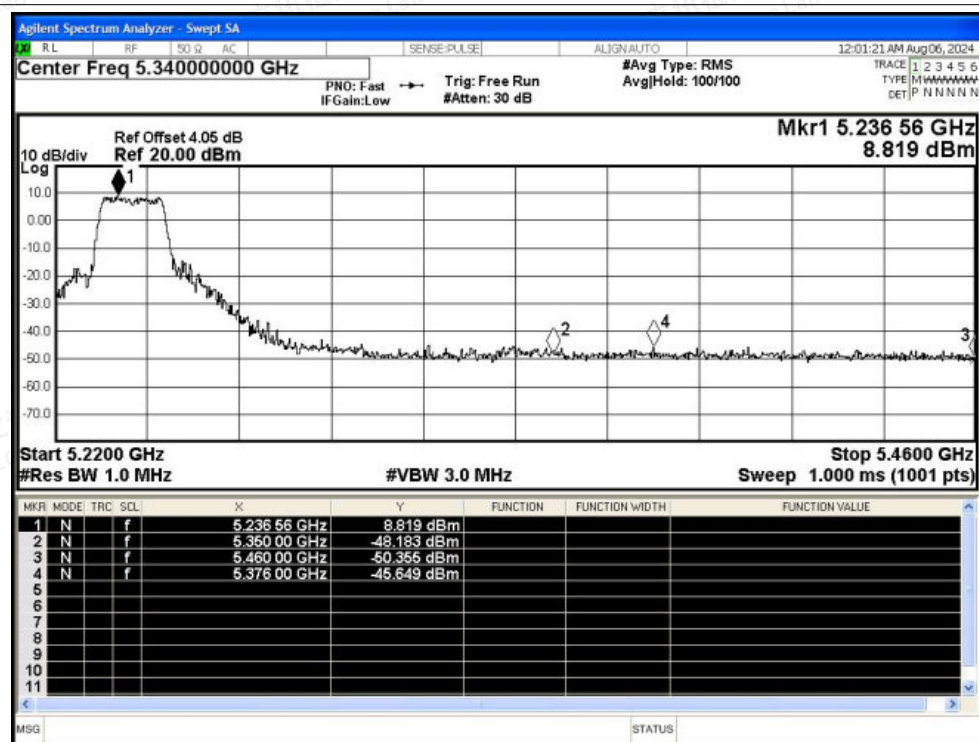

Restrict Band NVNT a 5240MHz Ant1 Average

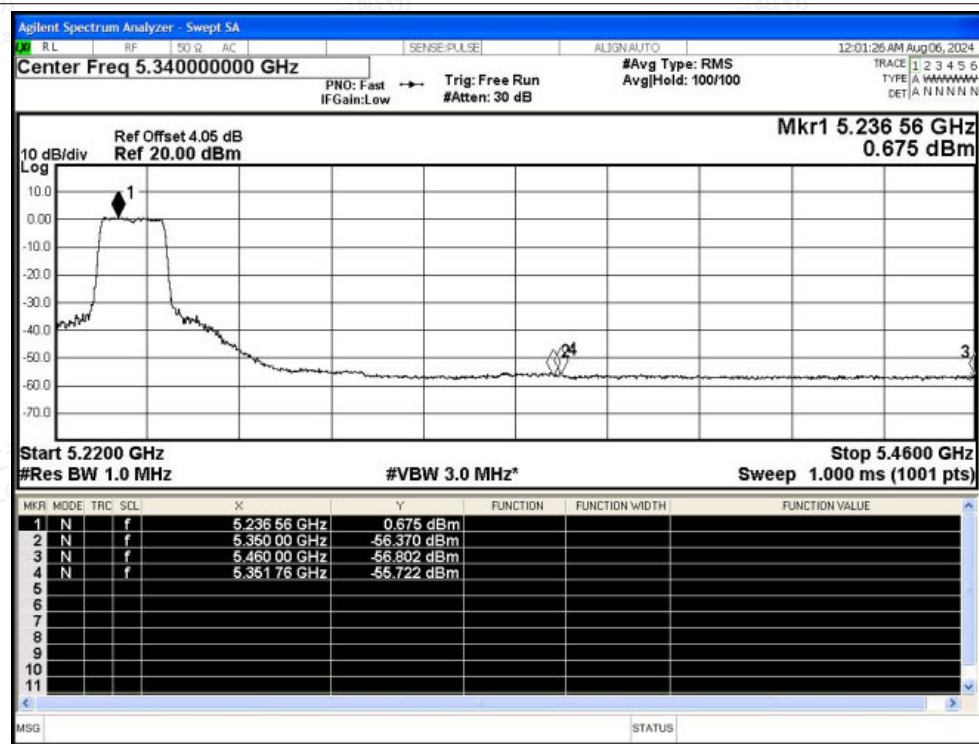

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant1 Peak

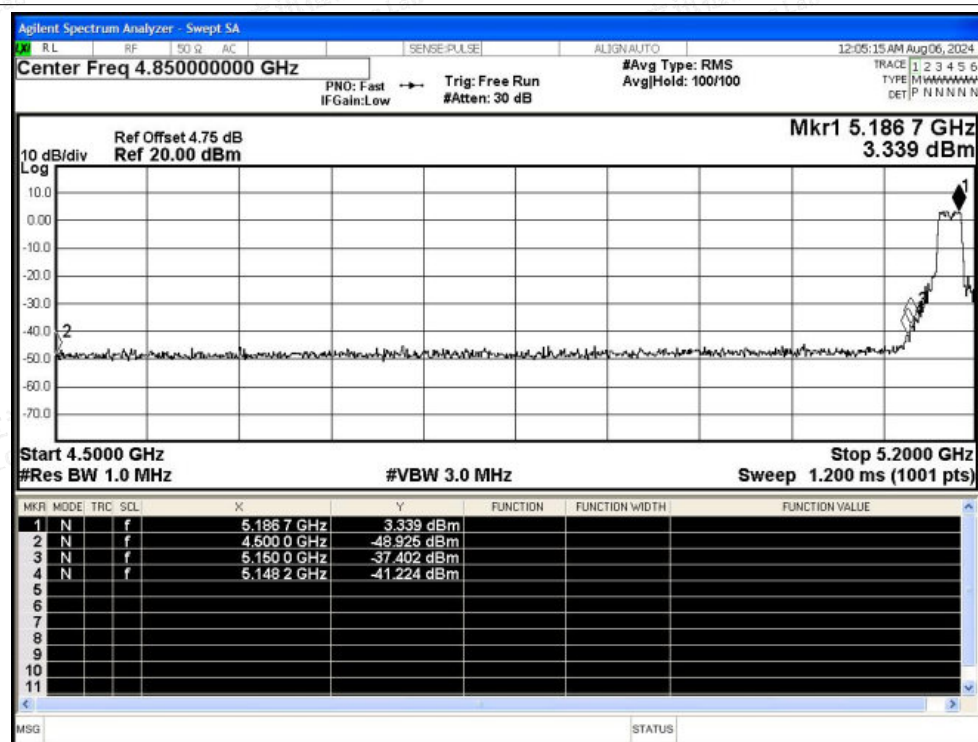

Restrict Band NVNT n20 5180MHz Ant1 Average

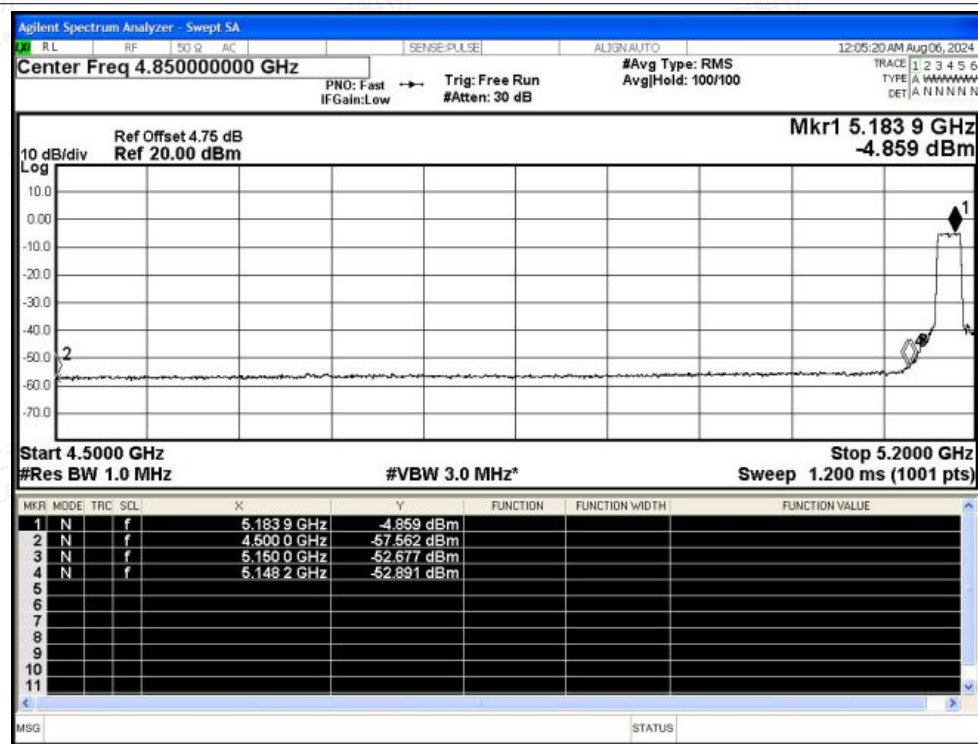

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant1 Peak

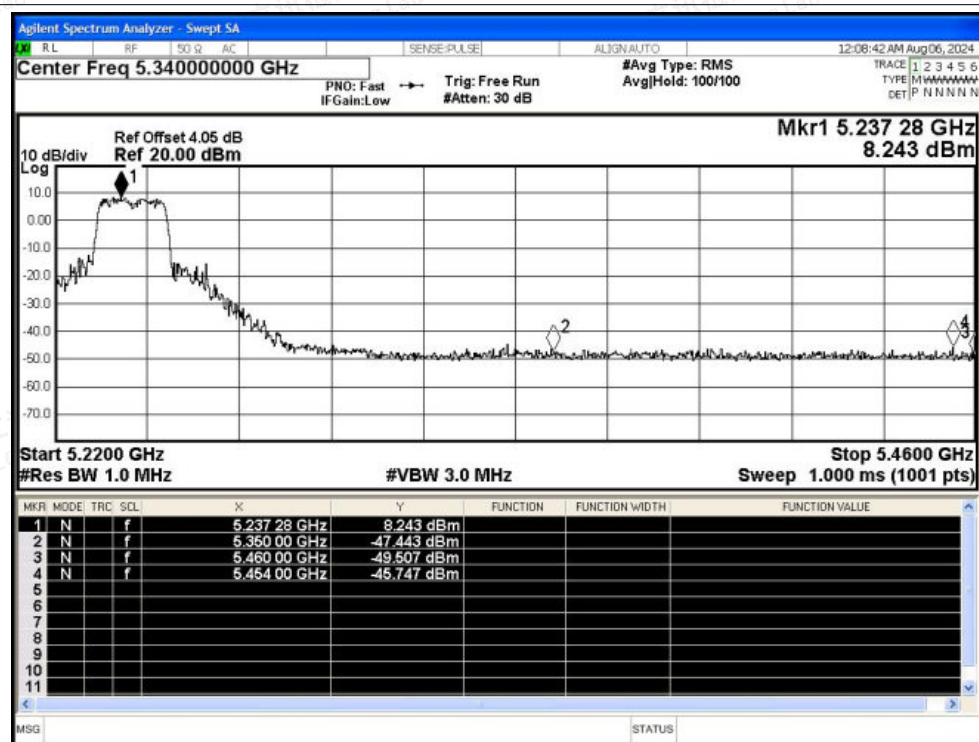

Restrict Band NVNT n20 5240MHz Ant1 Average

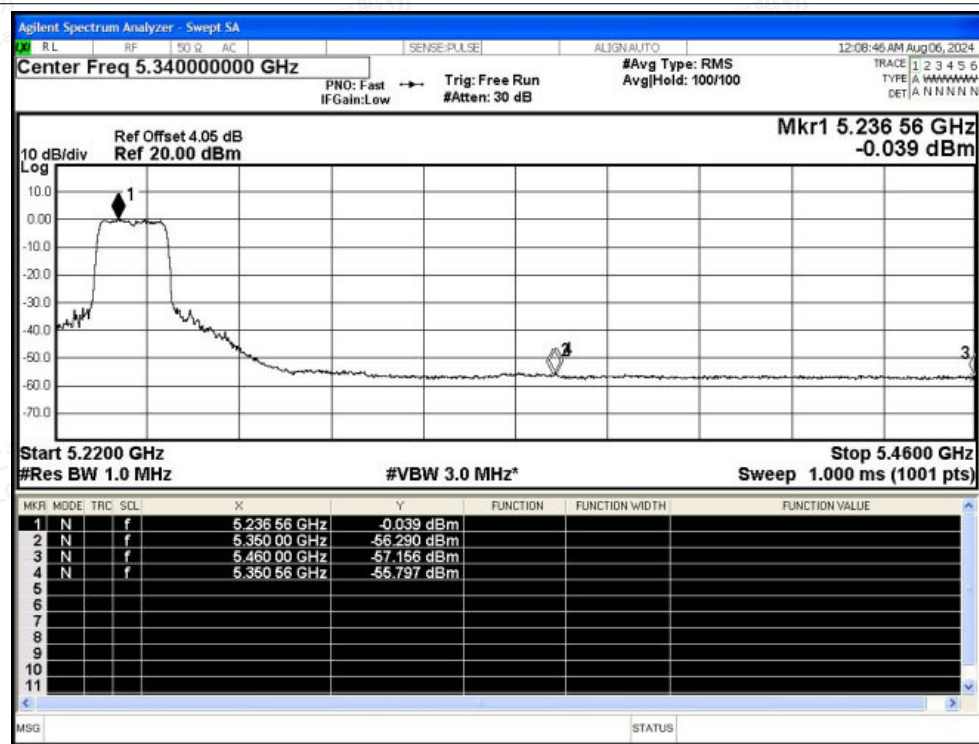

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant1 Peak

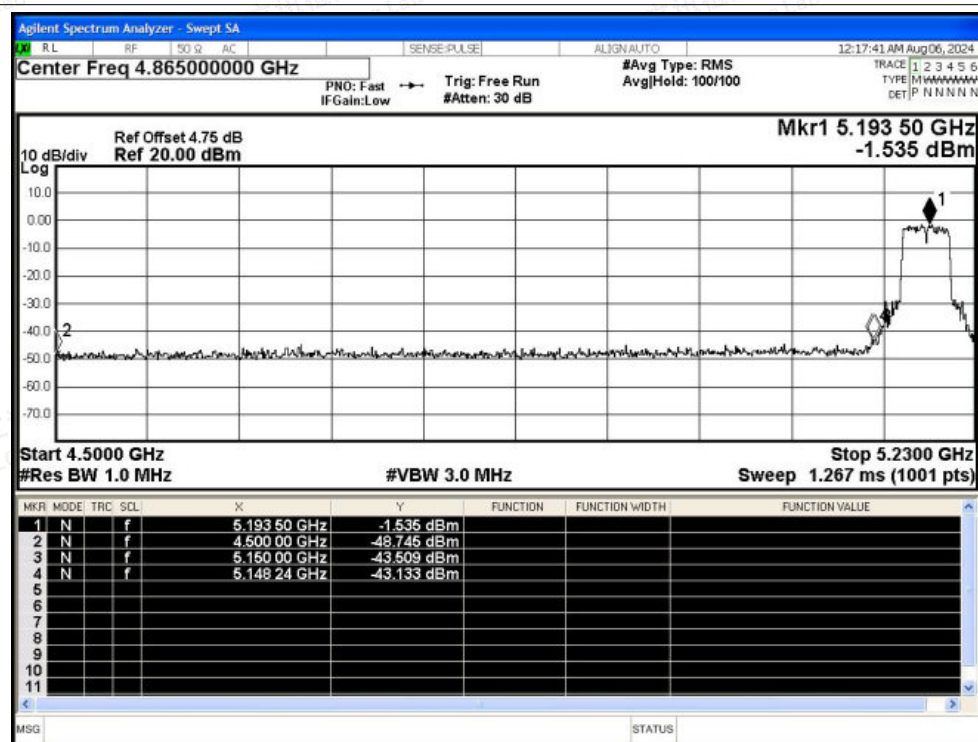

Restrict Band NVNT n40 5190MHz Ant1 Average

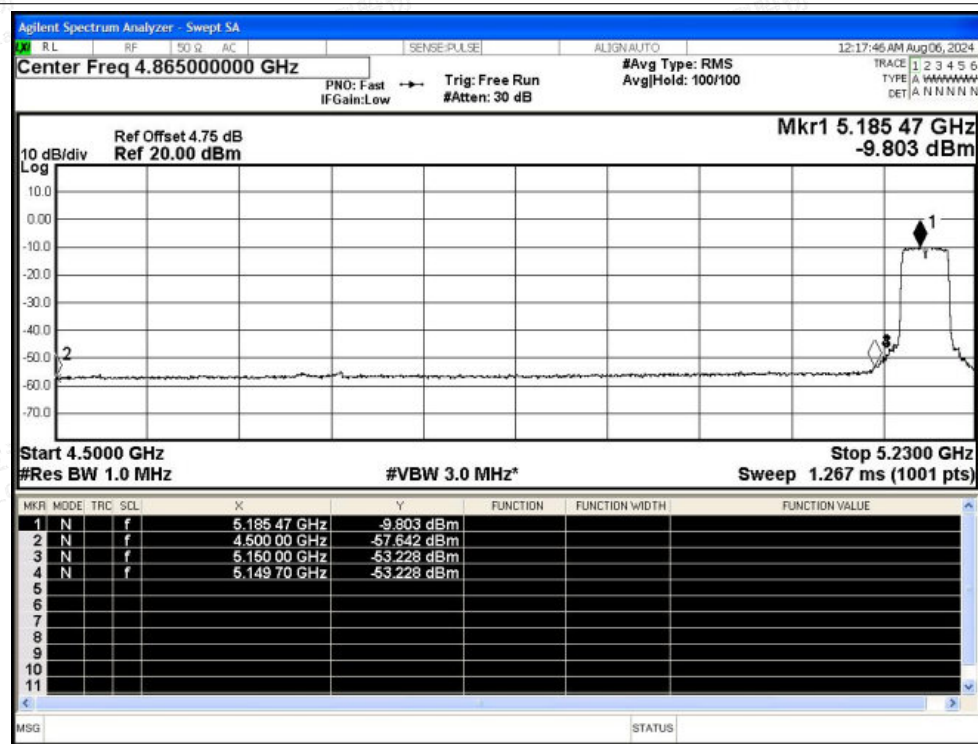

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant1 Peak

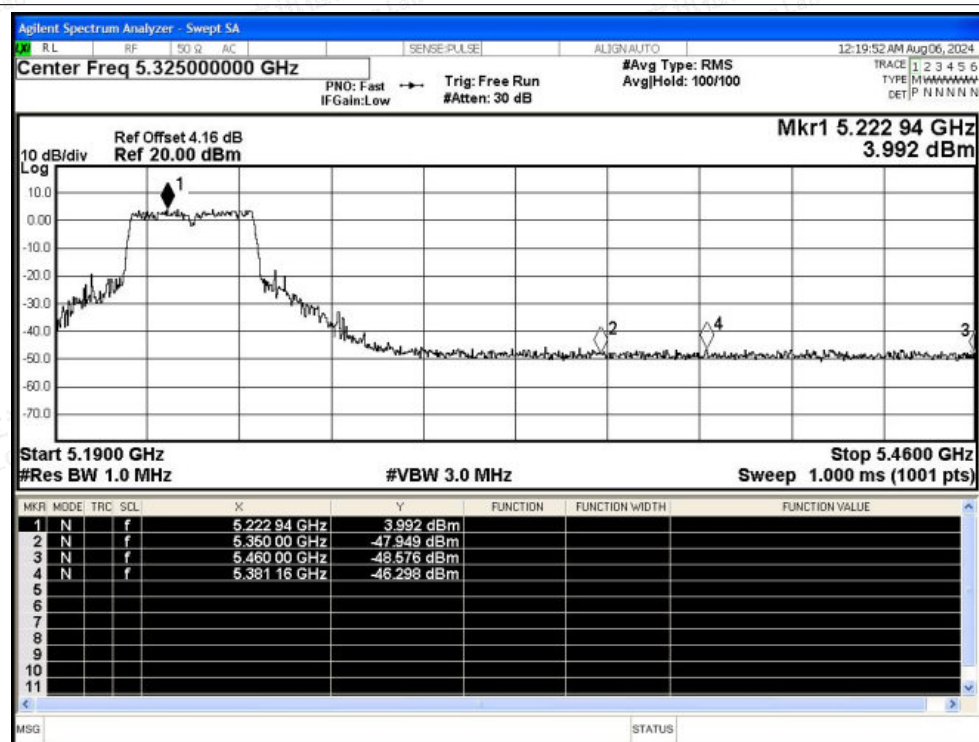

Restrict Band NVNT n40 5230MHz Ant1 Average

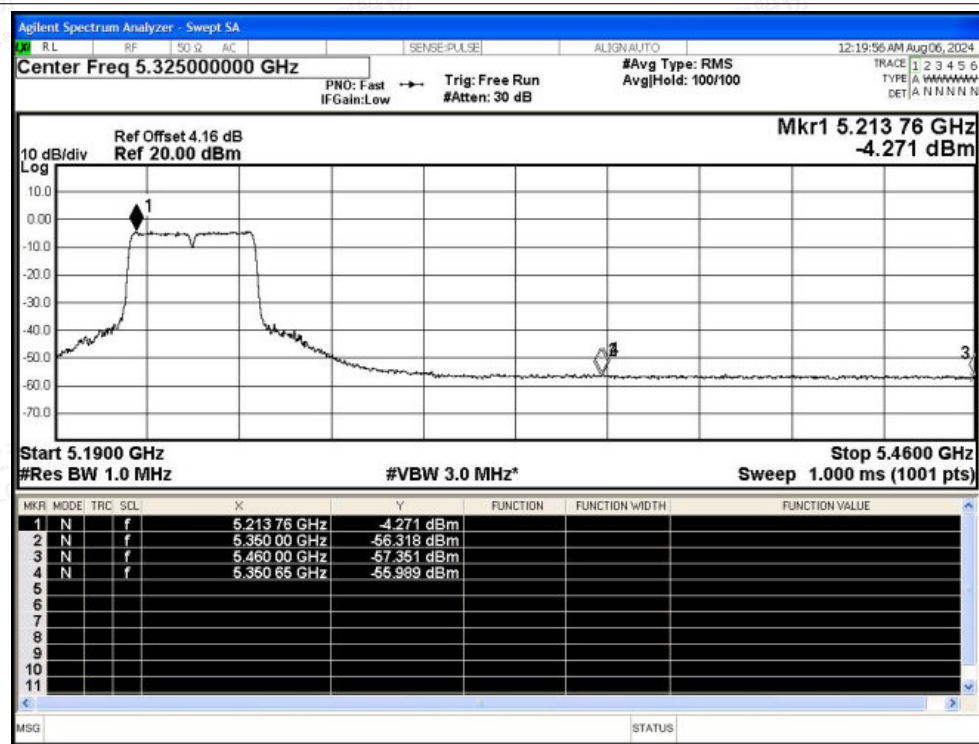

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant1 Peak

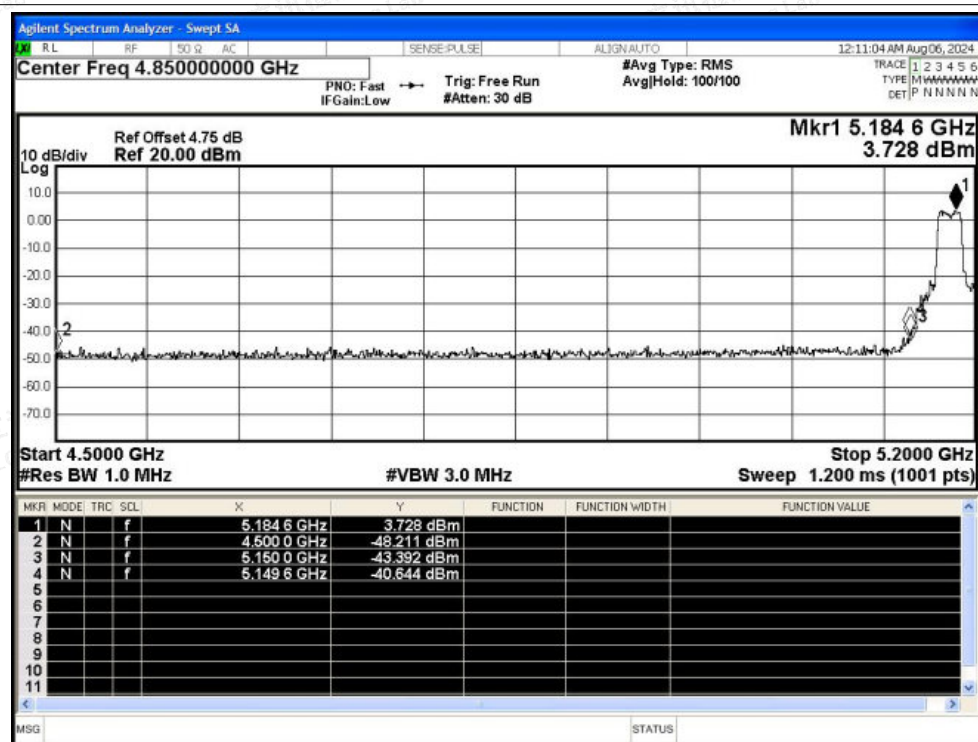

Restrict Band NVNT ac20 5180MHz Ant1 Average

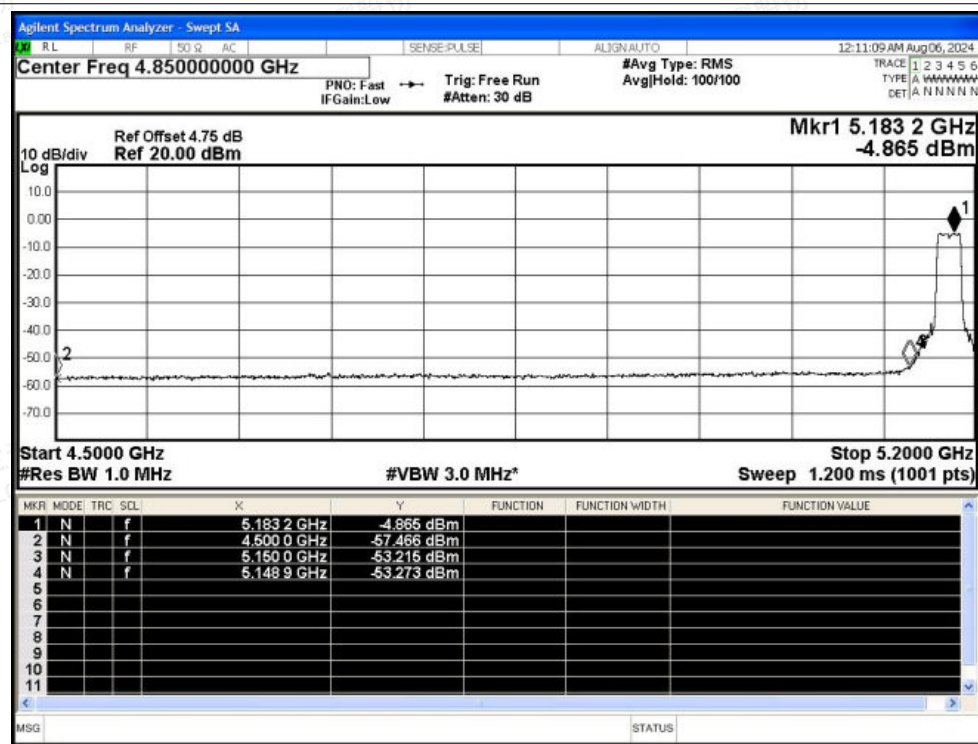

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant1 Peak

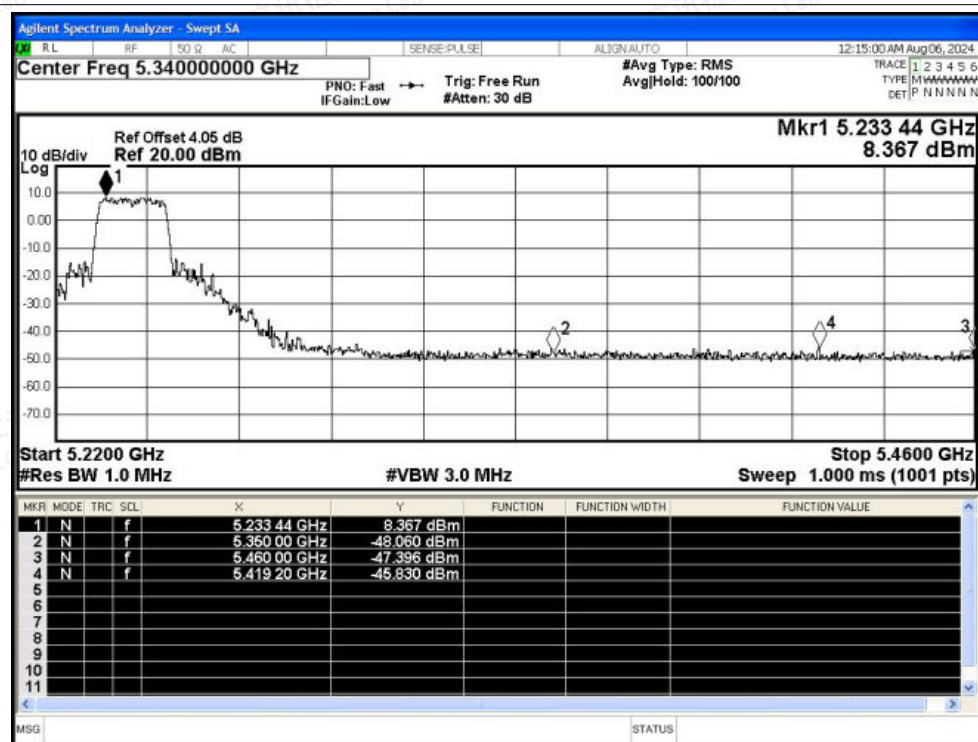

Restrict Band NVNT ac20 5240MHz Ant1 Average

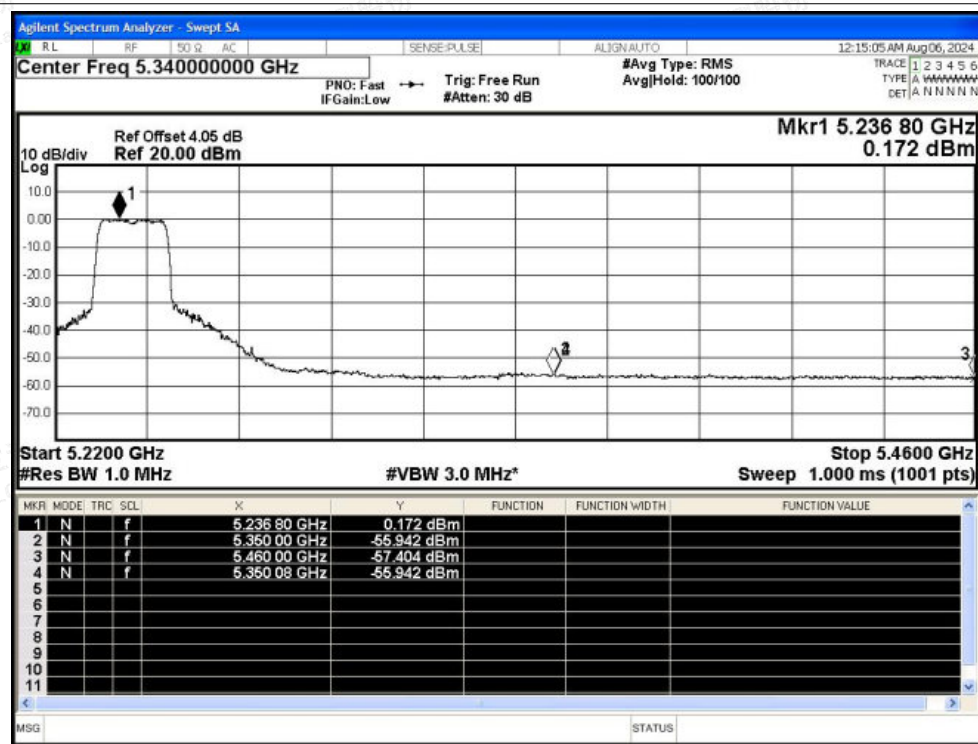

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant1 Peak

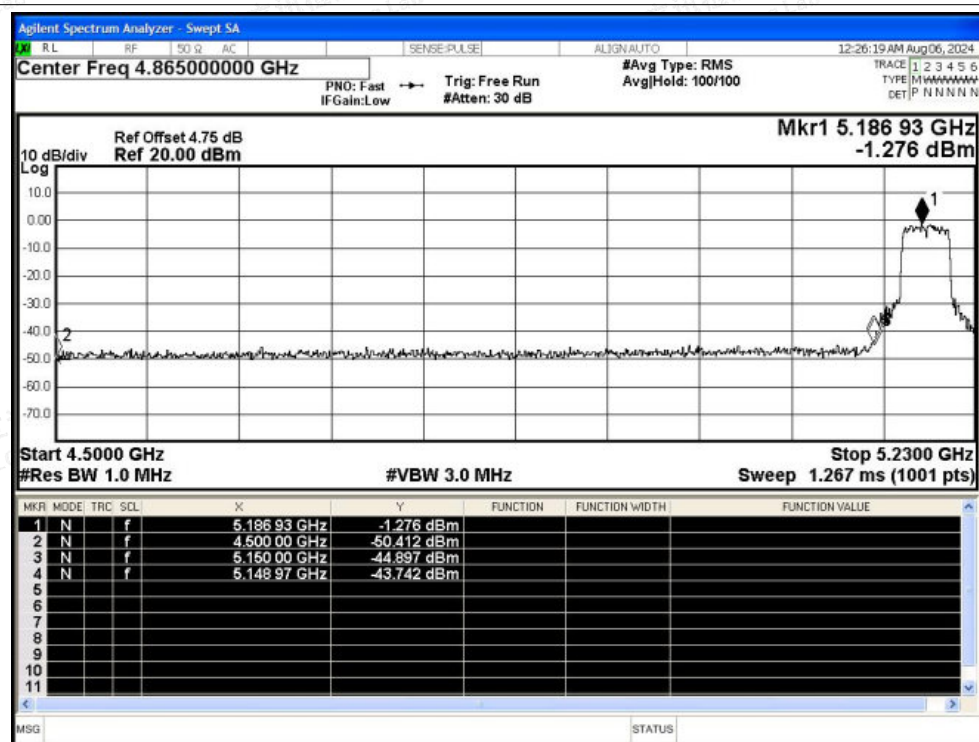

Restrict Band NVNT ac40 5190MHz Ant1 Average

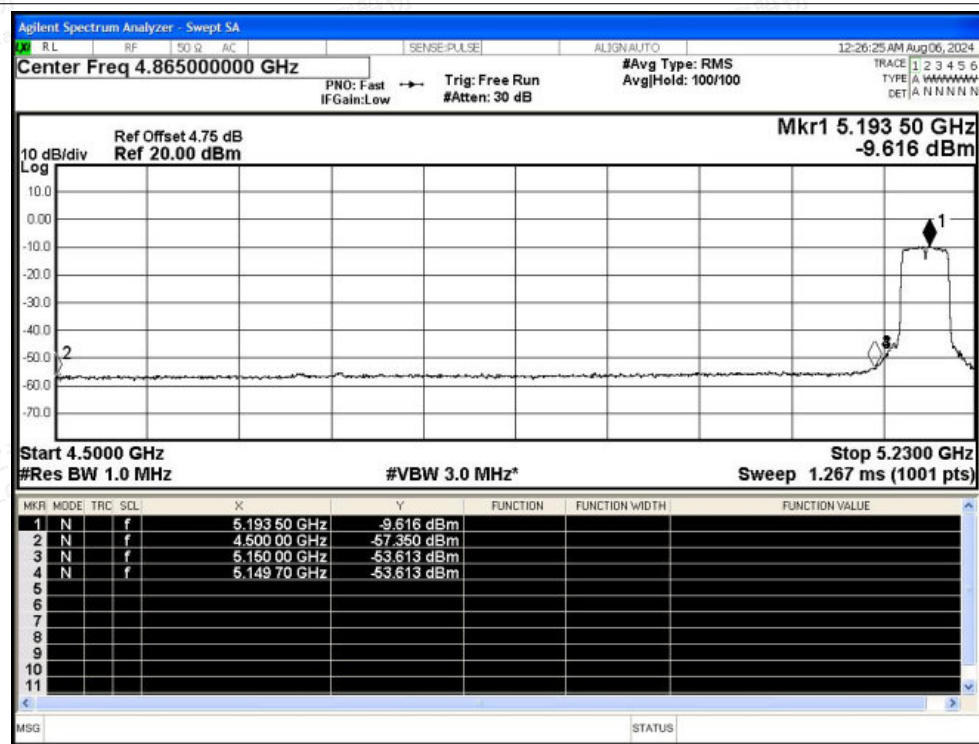

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant1 Peak

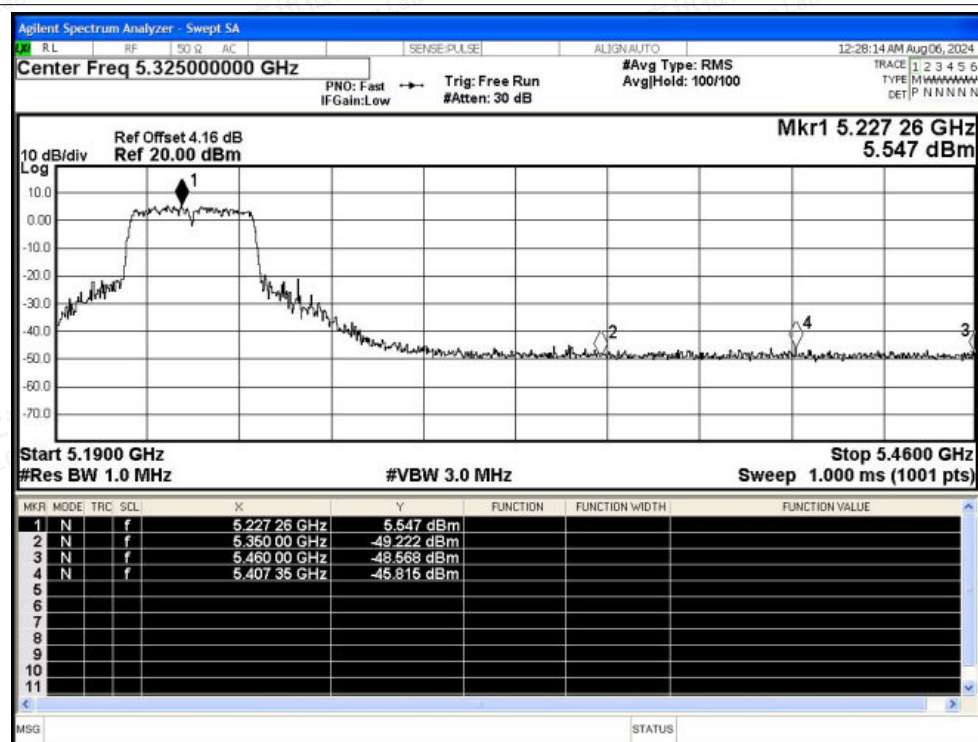

Restrict Band NVNT ac40 5230MHz Ant1 Average

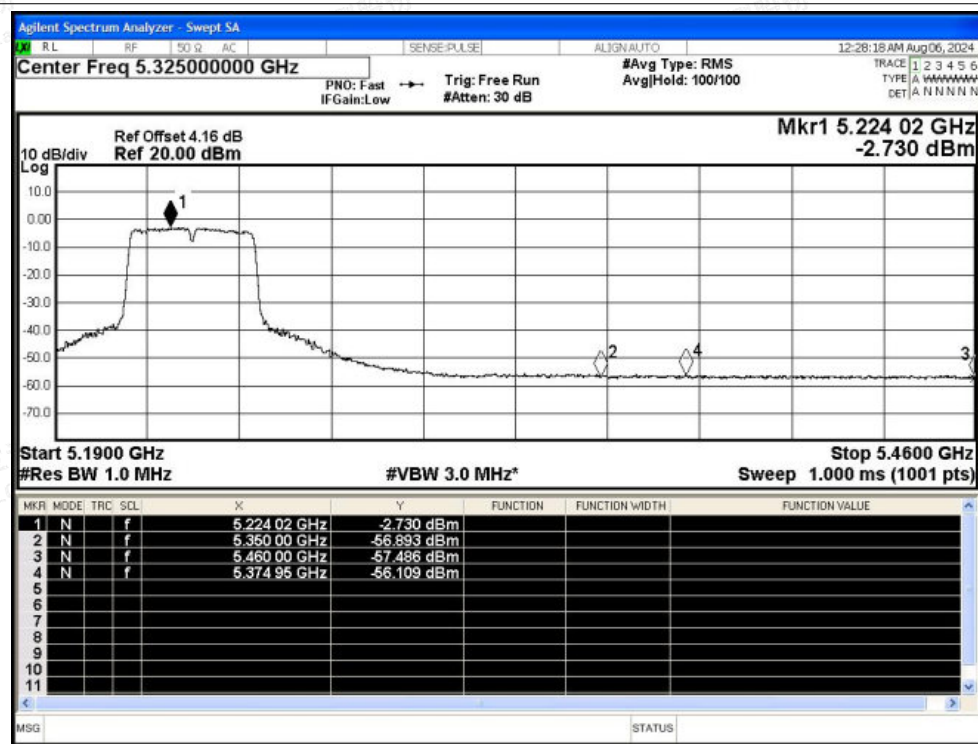

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

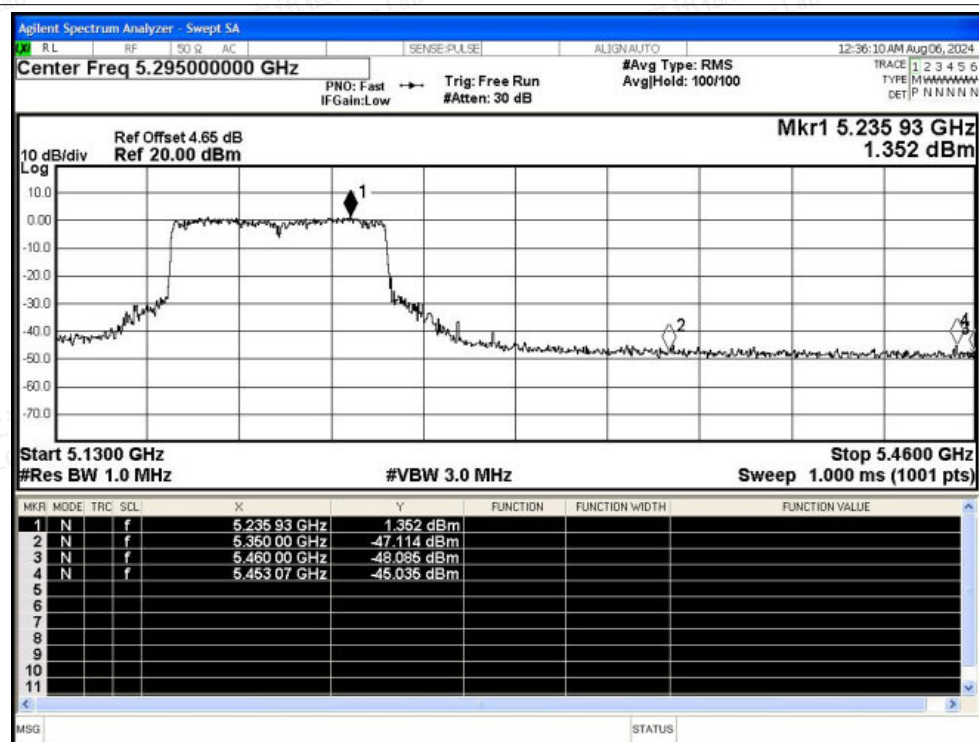

Restrict Band NVNT ac80 5210MHz Ant1 Average

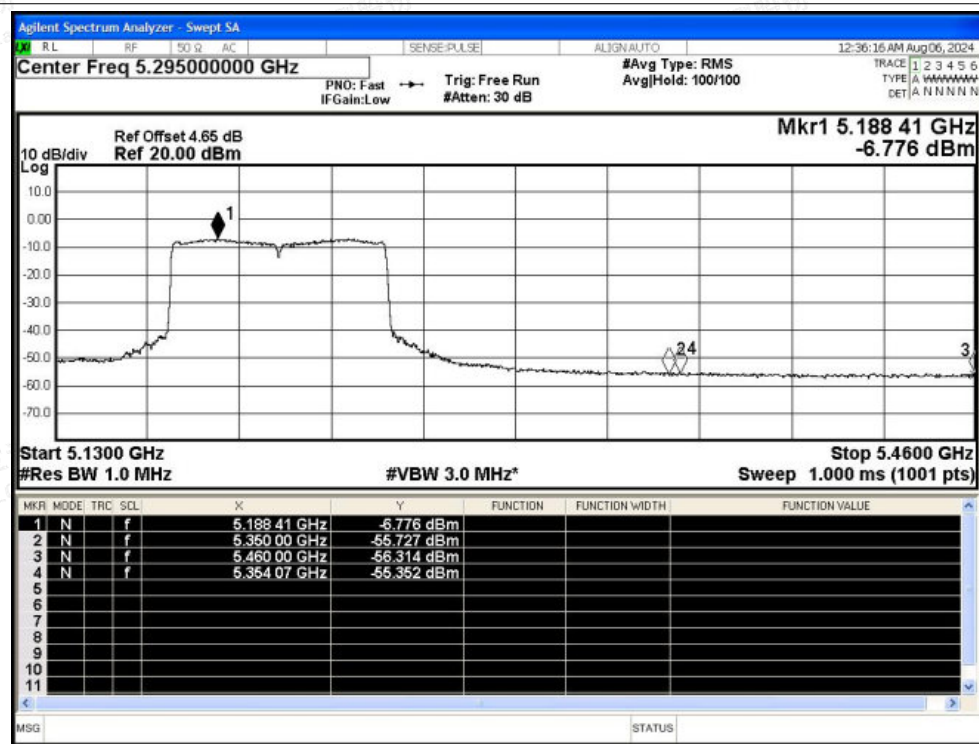

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant1 Peak

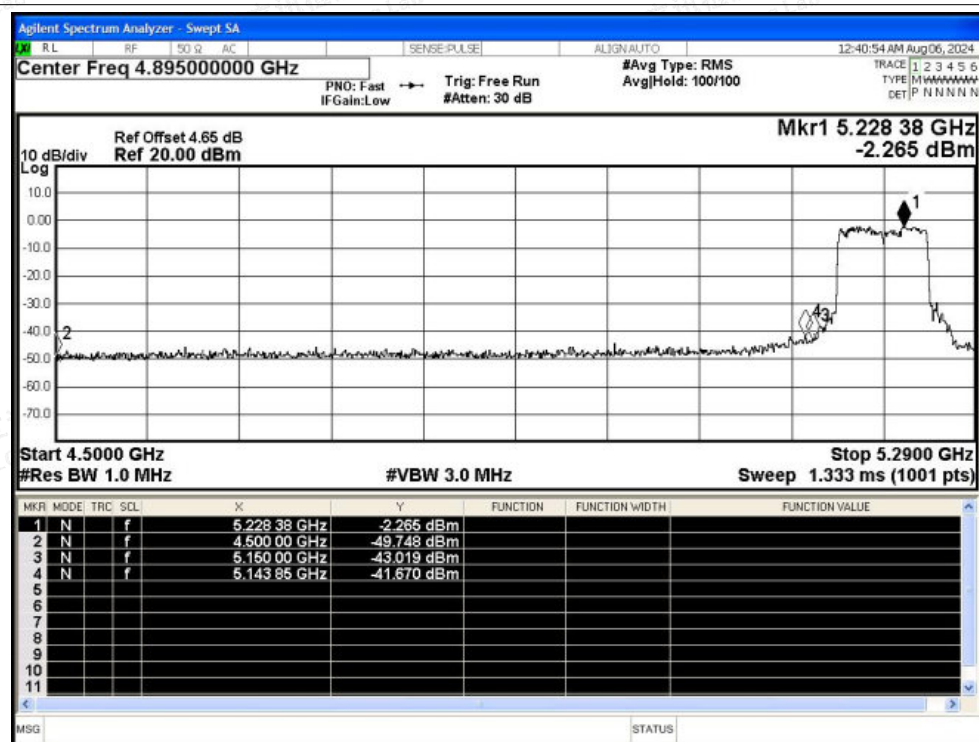

Restrict Band NVNT ac80 5210MHz Ant1 Average

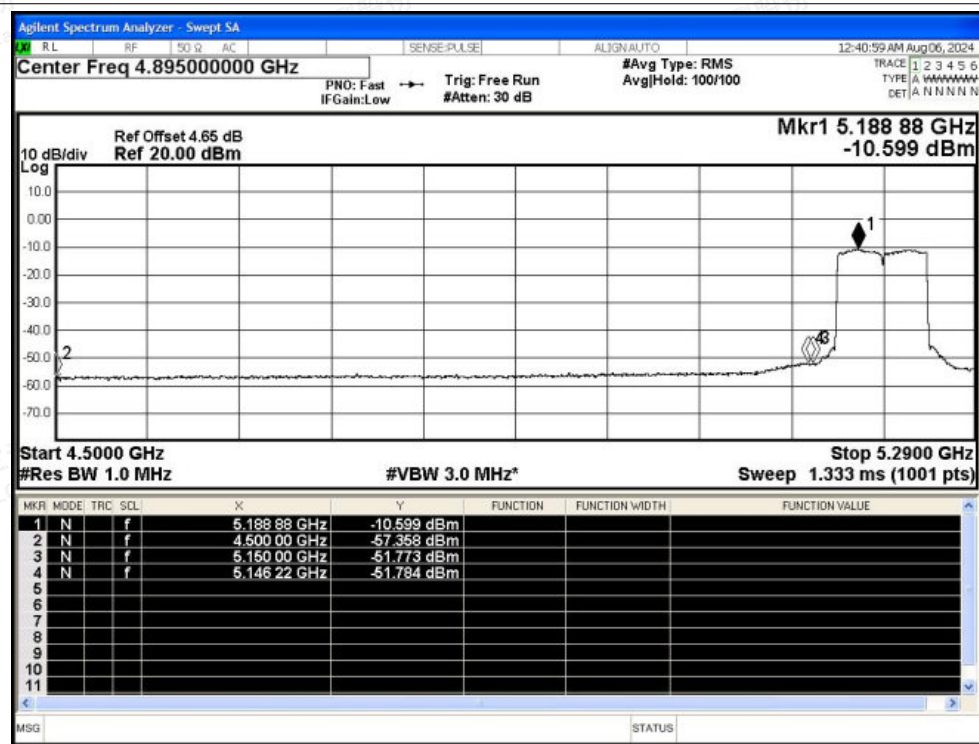

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

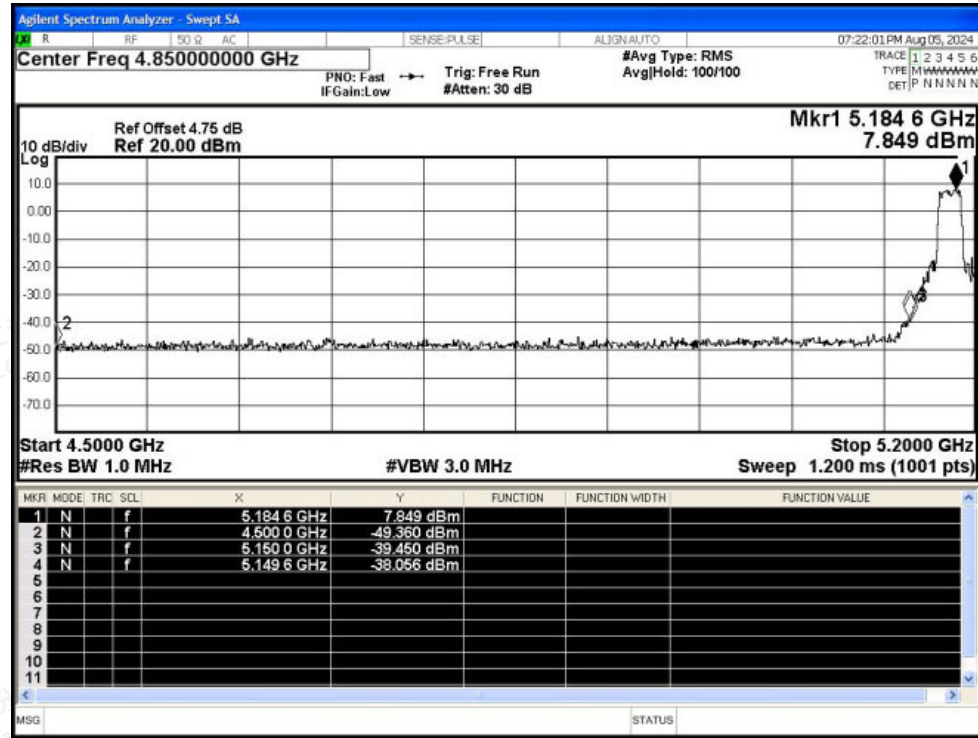

Restrict Band NVNT a 5180MHz Ant2 Average

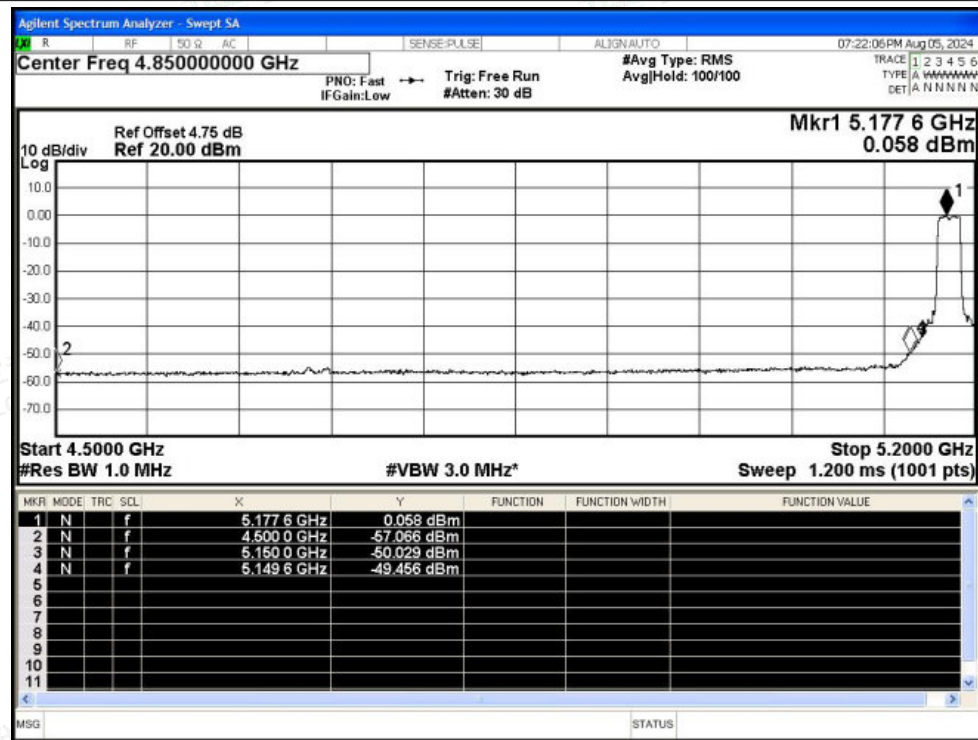

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5240MHz Ant2 Peak

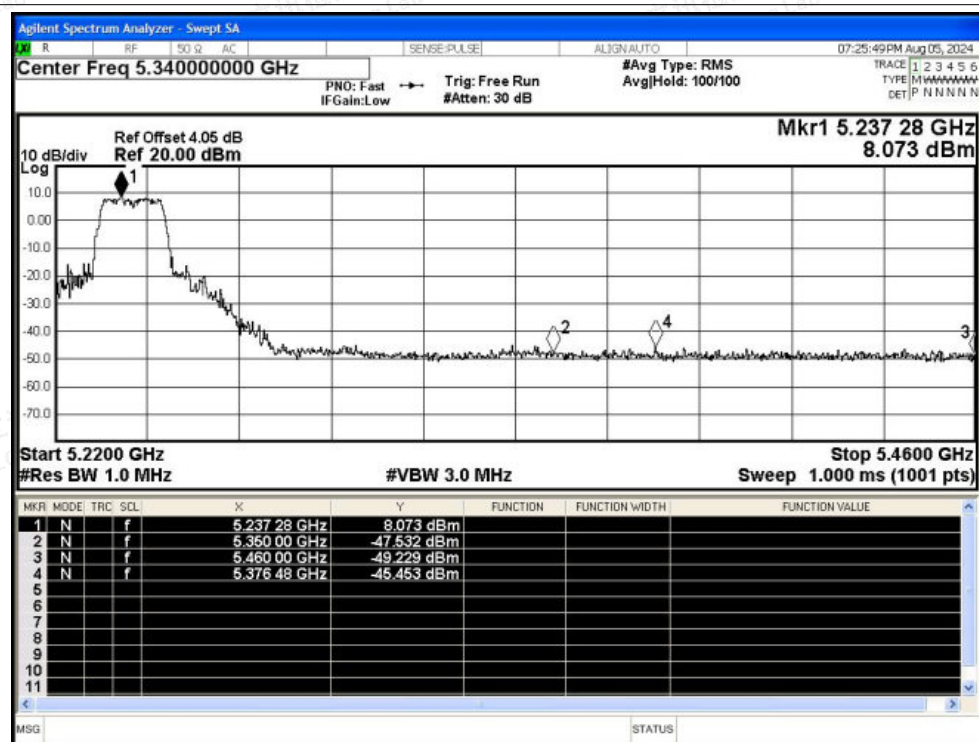

Restrict Band NVNT a 5240MHz Ant2 Average

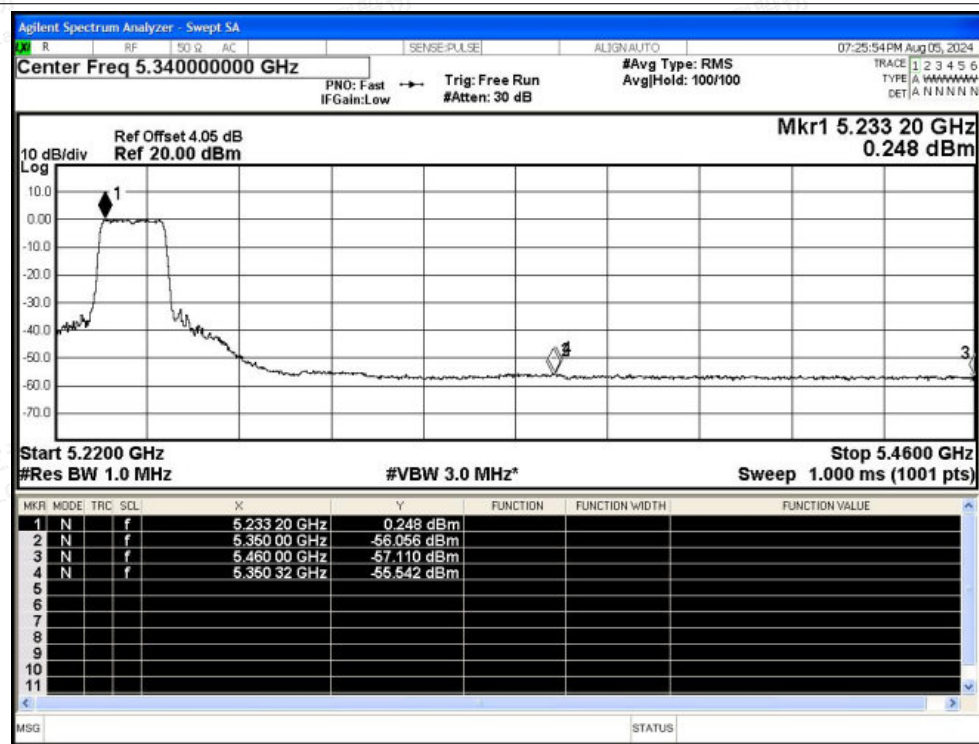

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5180MHz Ant2 Peak

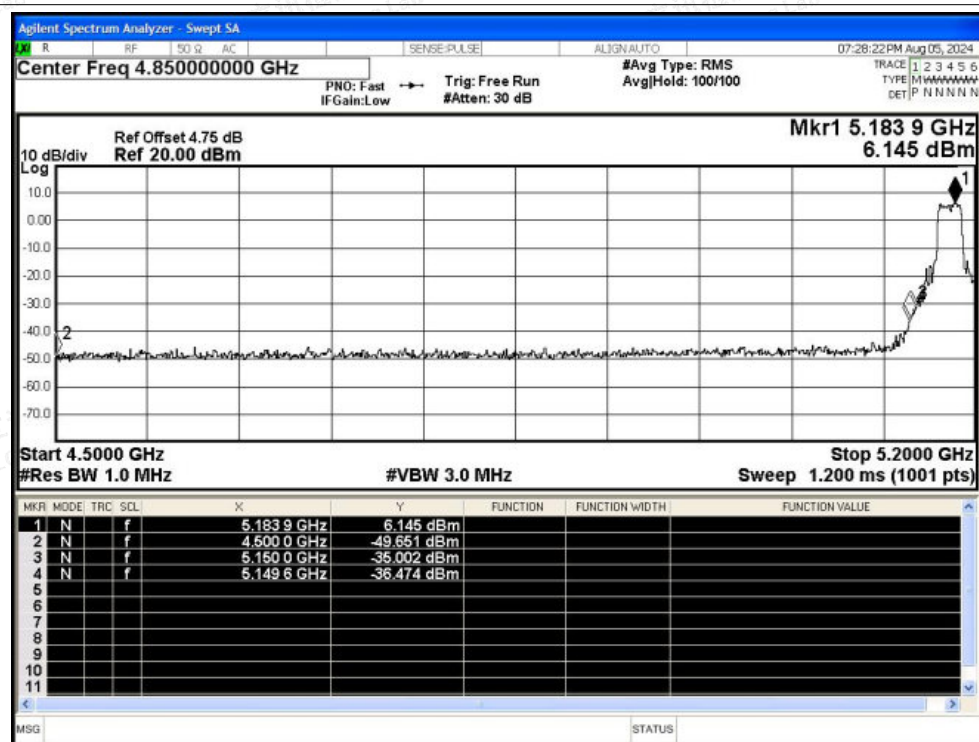

Restrict Band NVNT n20 5180MHz Ant2 Average

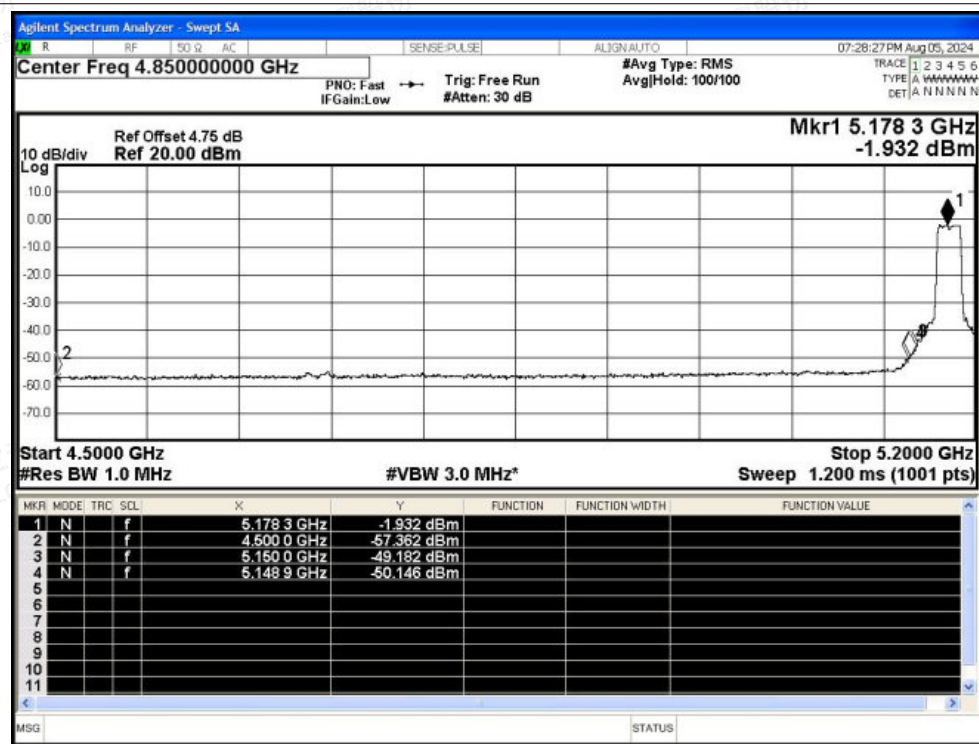

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5240MHz Ant2 Peak

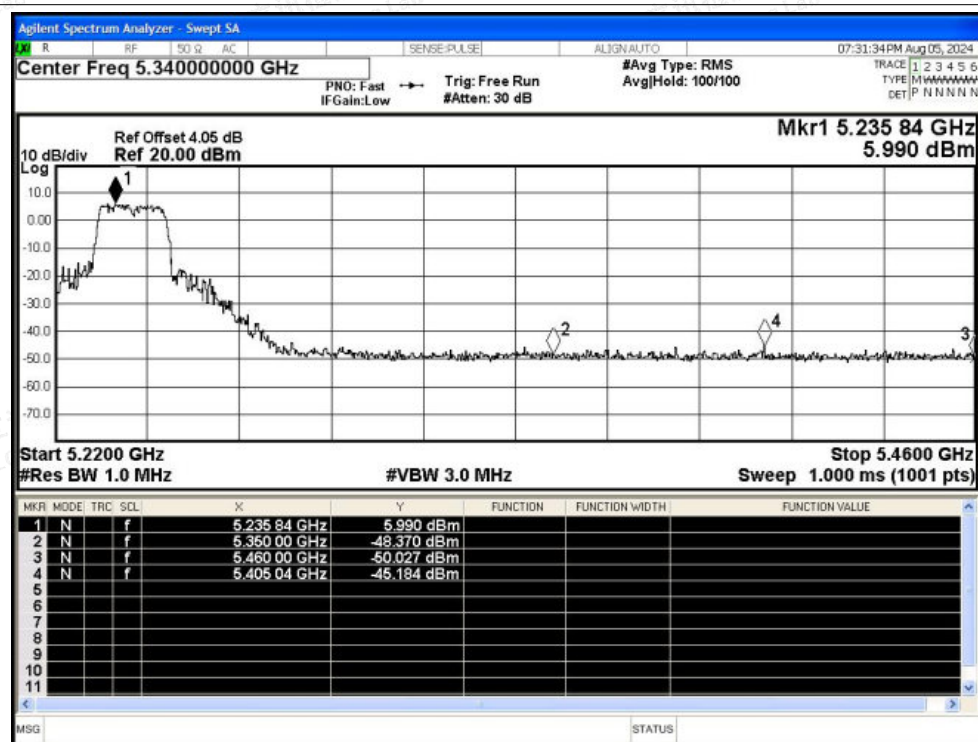

Restrict Band NVNT n20 5240MHz Ant2 Average

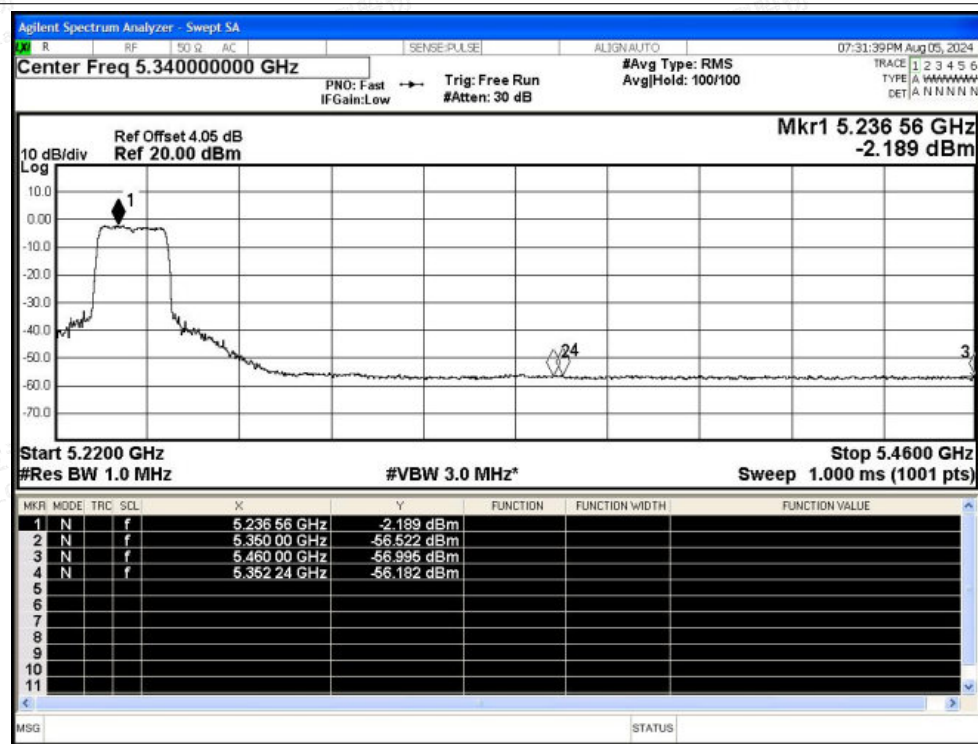

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5190MHz Ant2 Peak

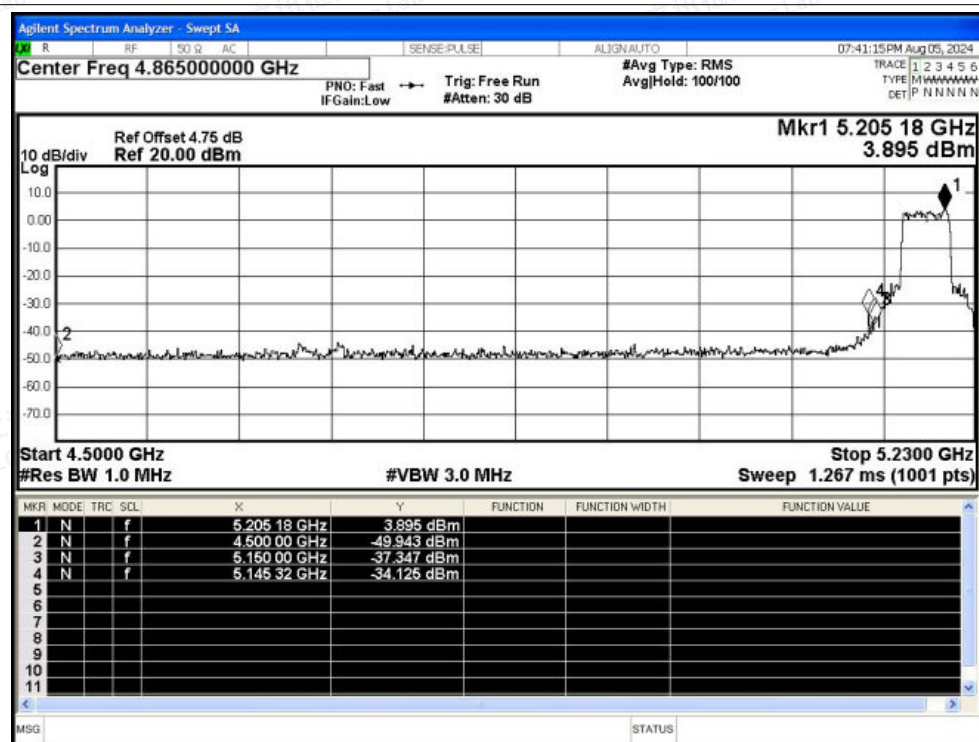

Restrict Band NVNT n40 5190MHz Ant2 Average

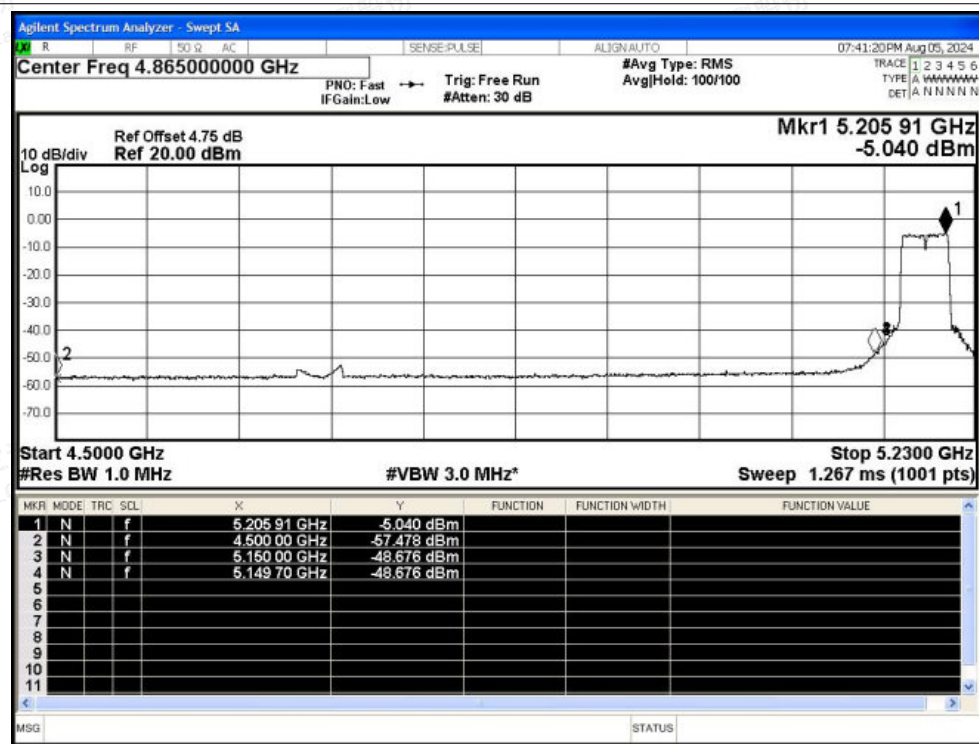

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5230MHz Ant2 Peak

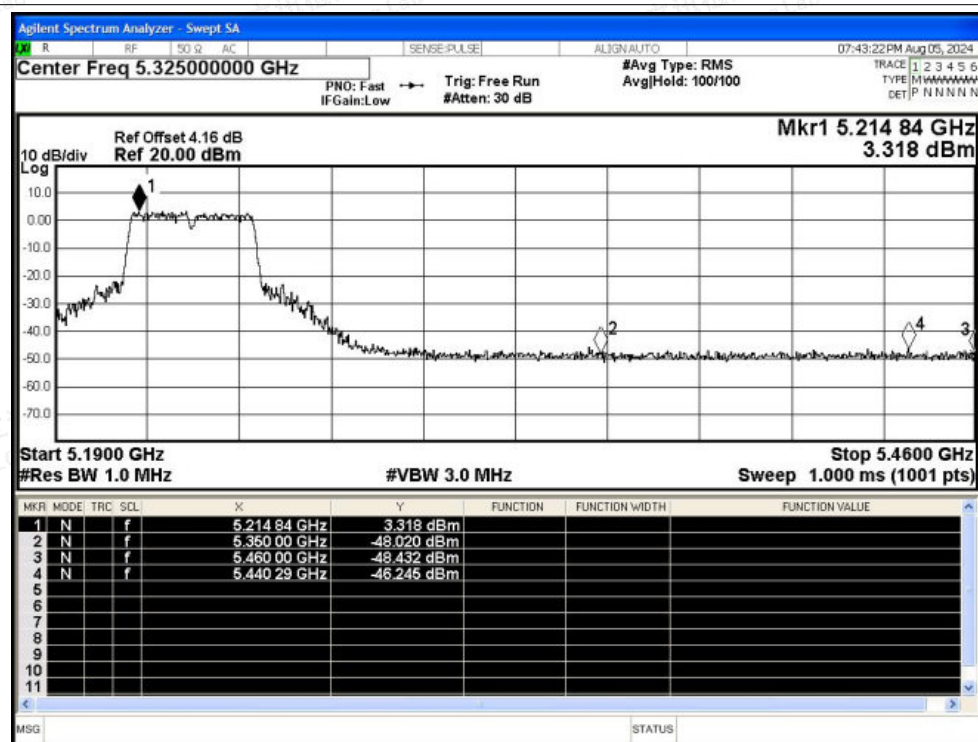

Restrict Band NVNT n40 5230MHz Ant2 Average

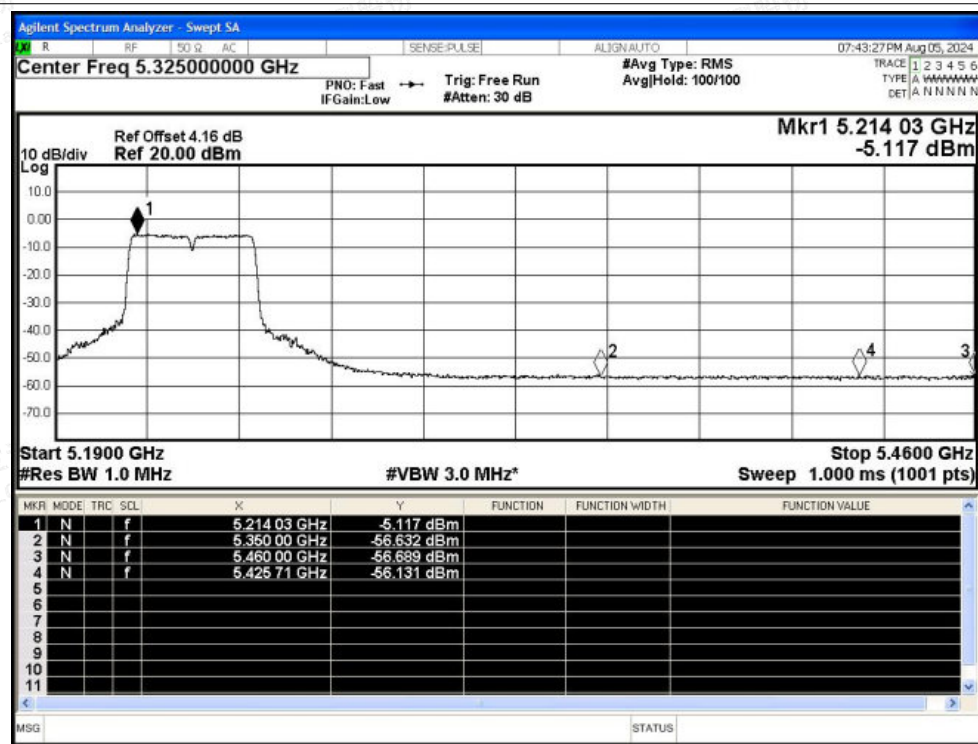

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5180MHz Ant2 Peak

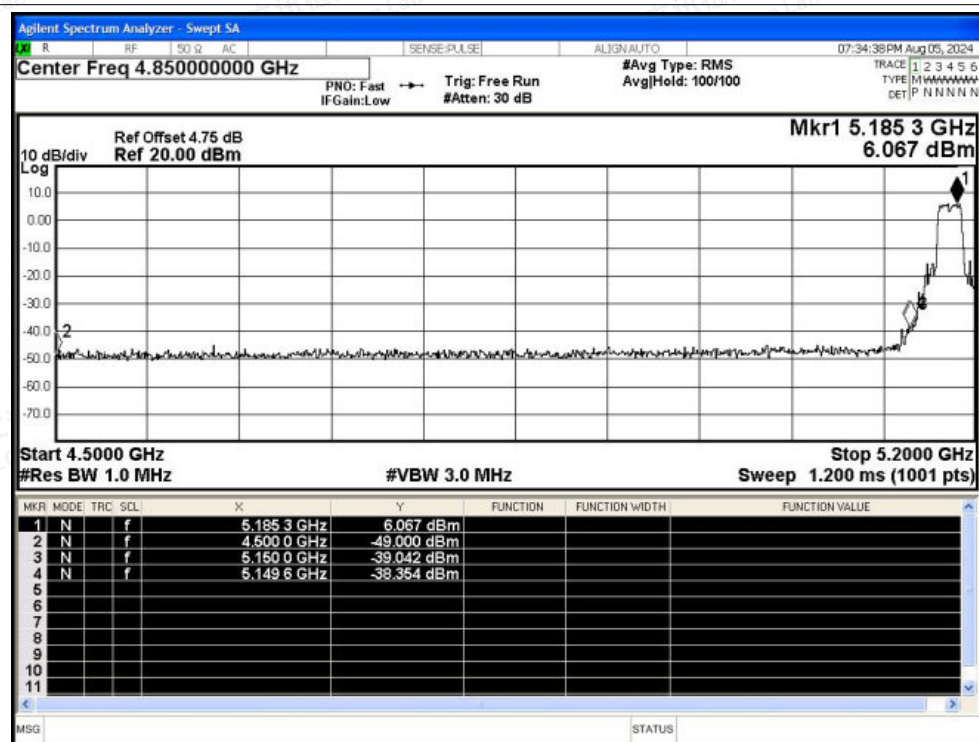

Restrict Band NVNT ac20 5180MHz Ant2 Average

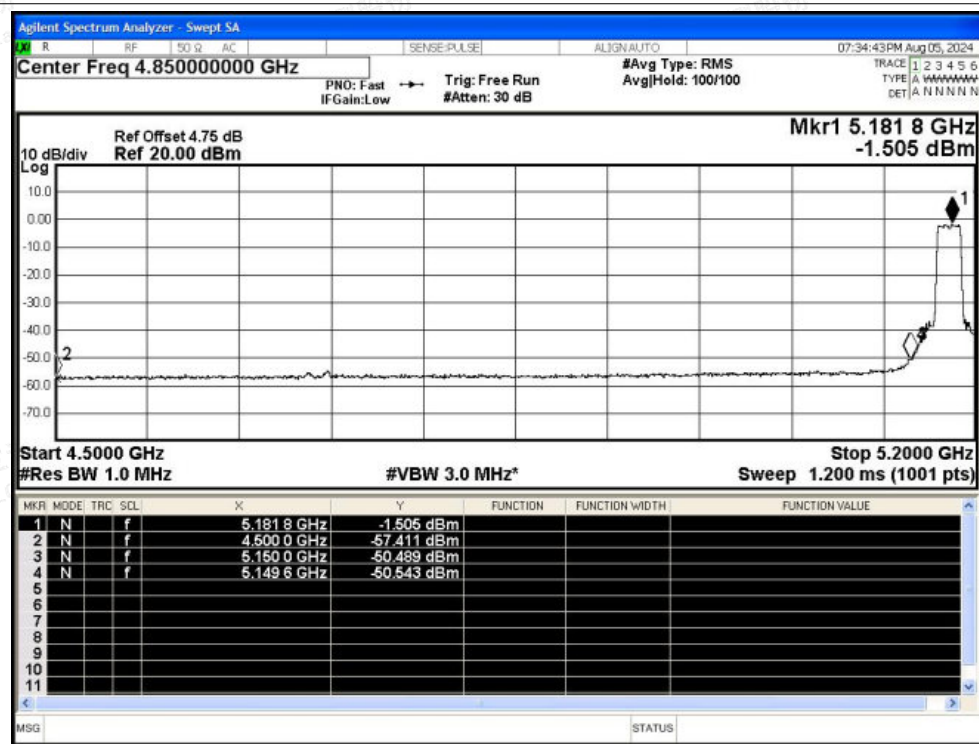

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5240MHz Ant2 Peak

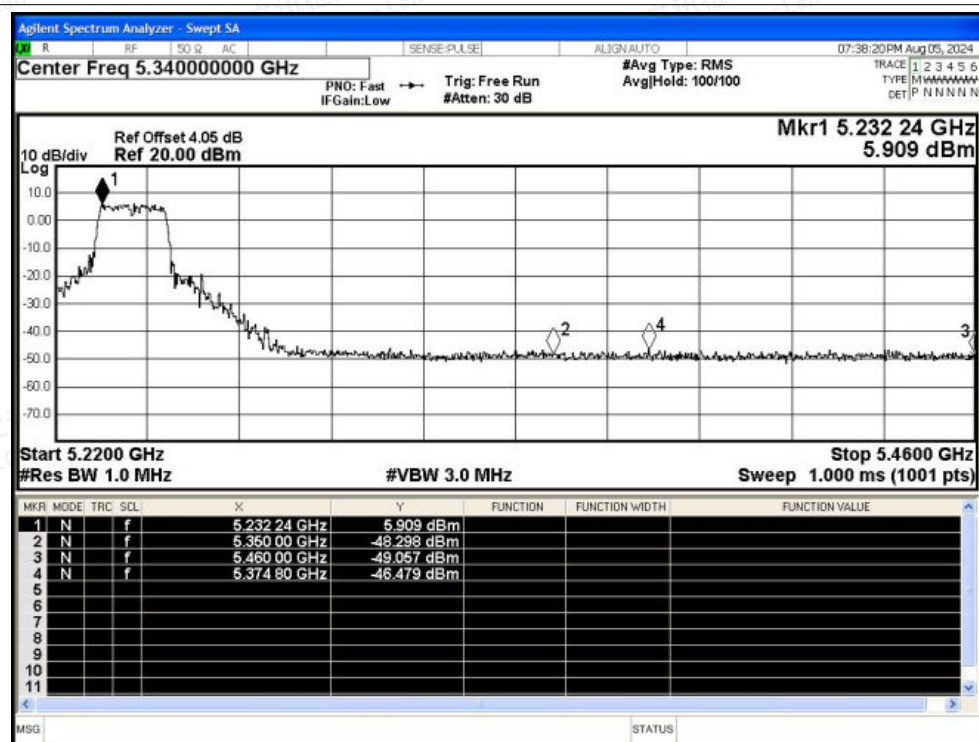

Restrict Band NVNT ac20 5240MHz Ant2 Average

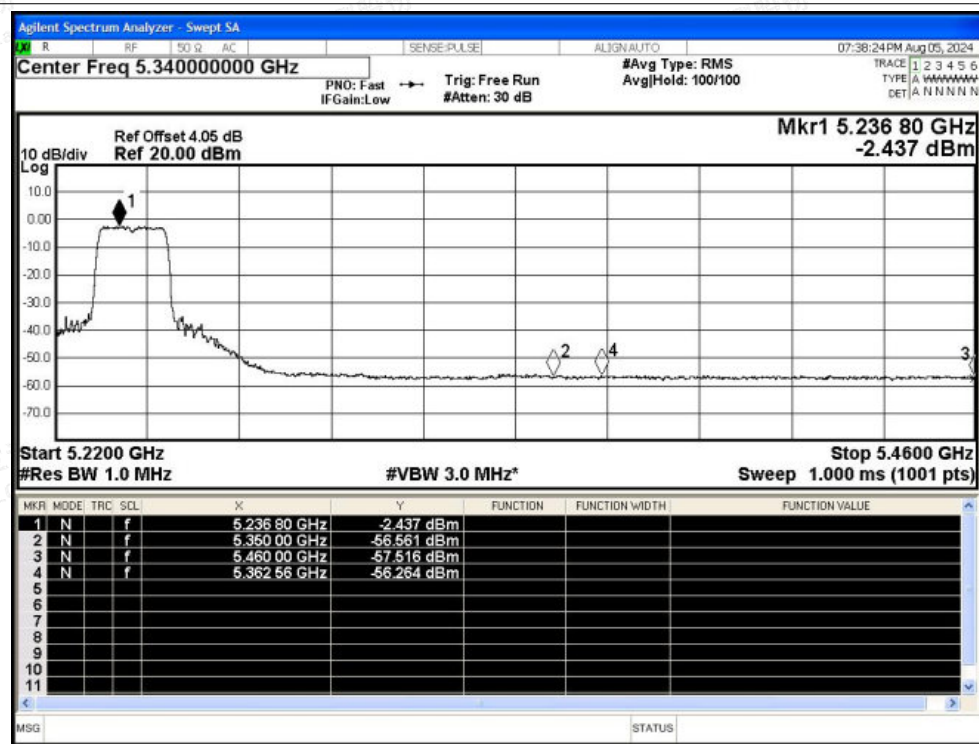

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5190MHz Ant2 Peak

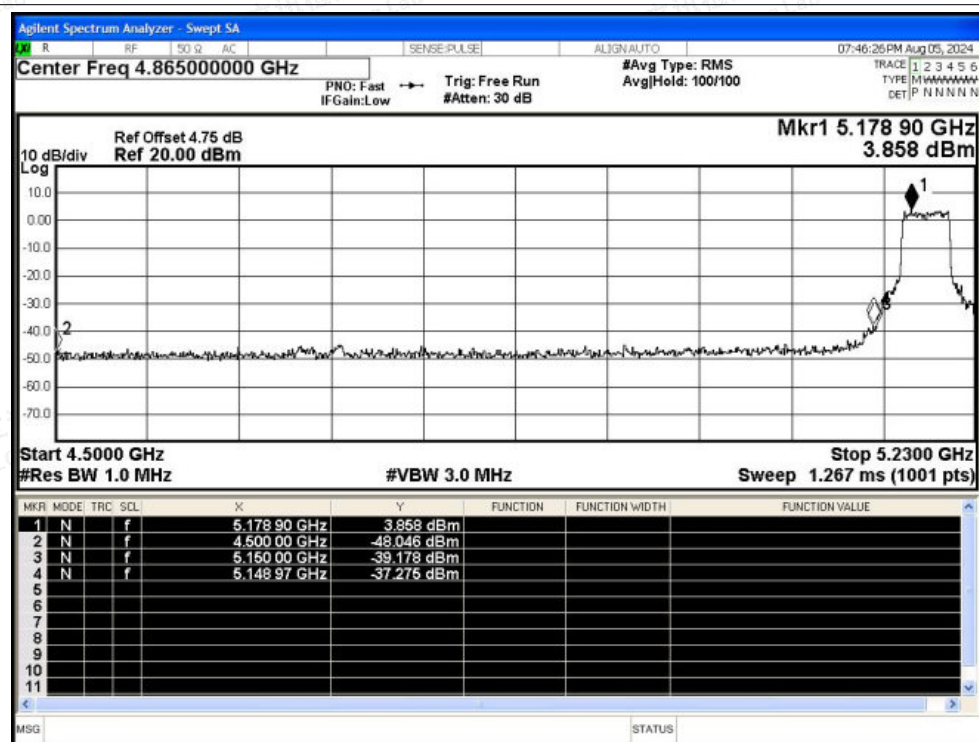

Restrict Band NVNT ac40 5190MHz Ant2 Average

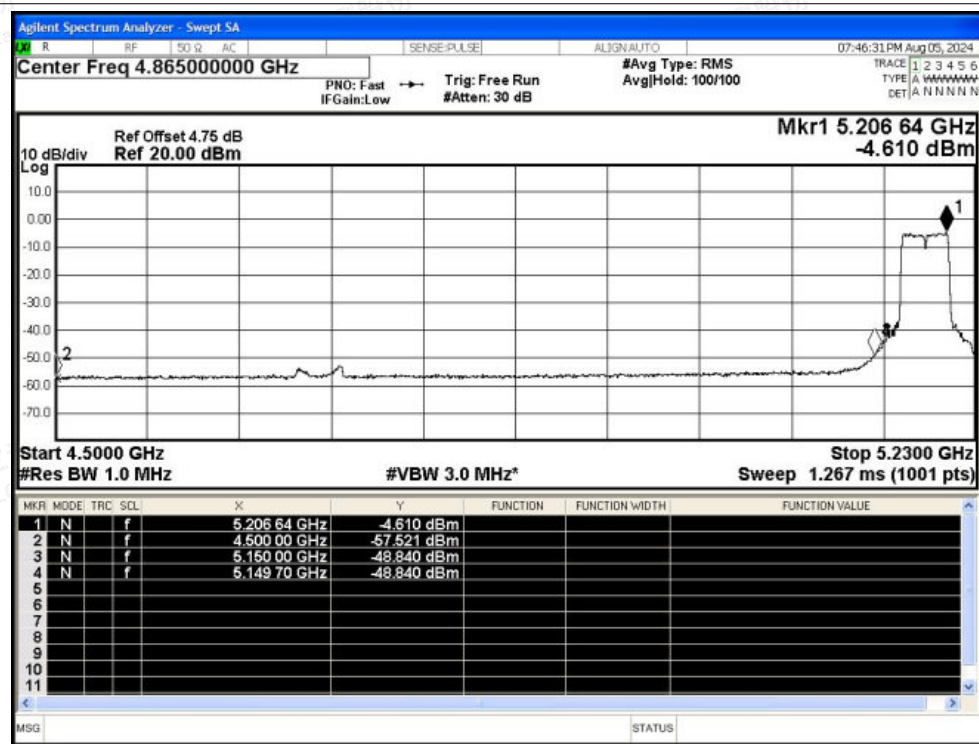

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5230MHz Ant2 Peak

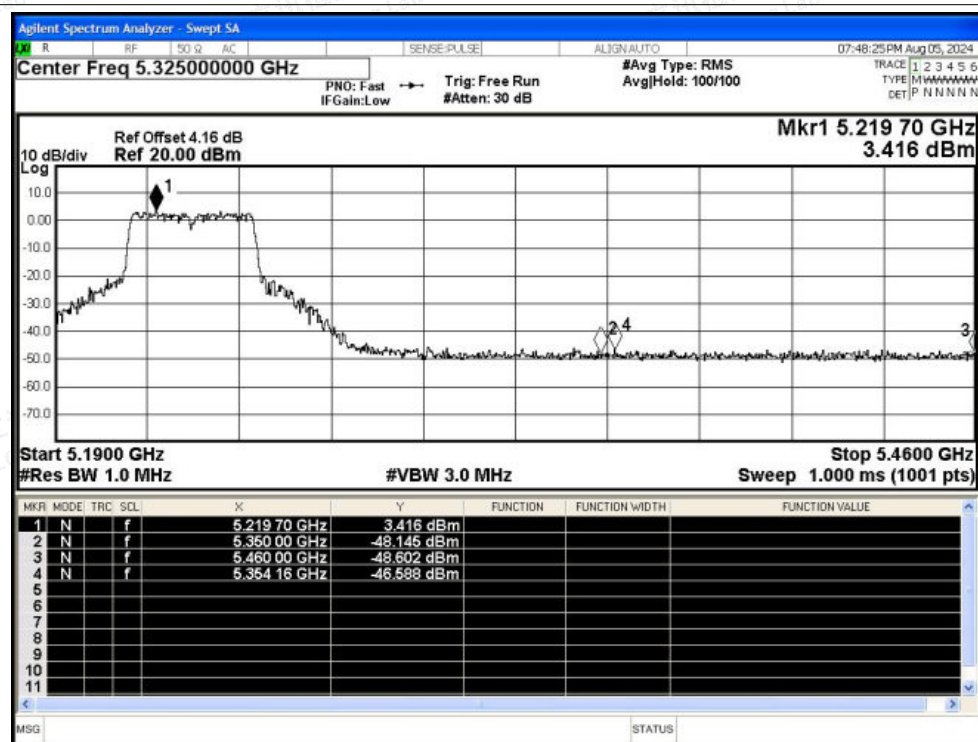

Restrict Band NVNT ac40 5230MHz Ant2 Average

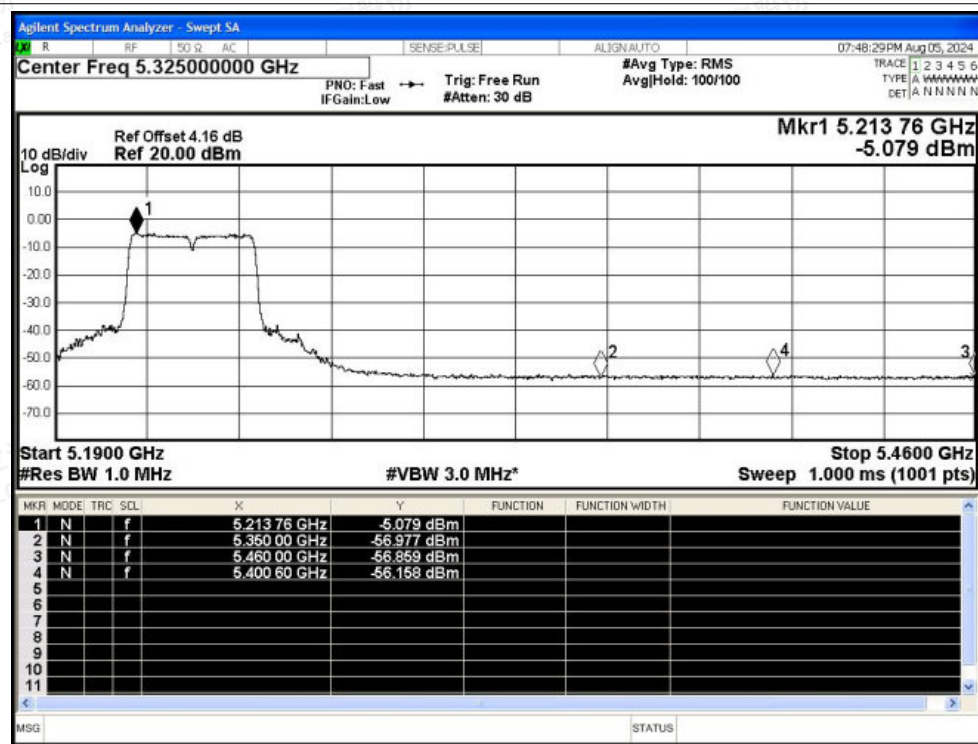

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

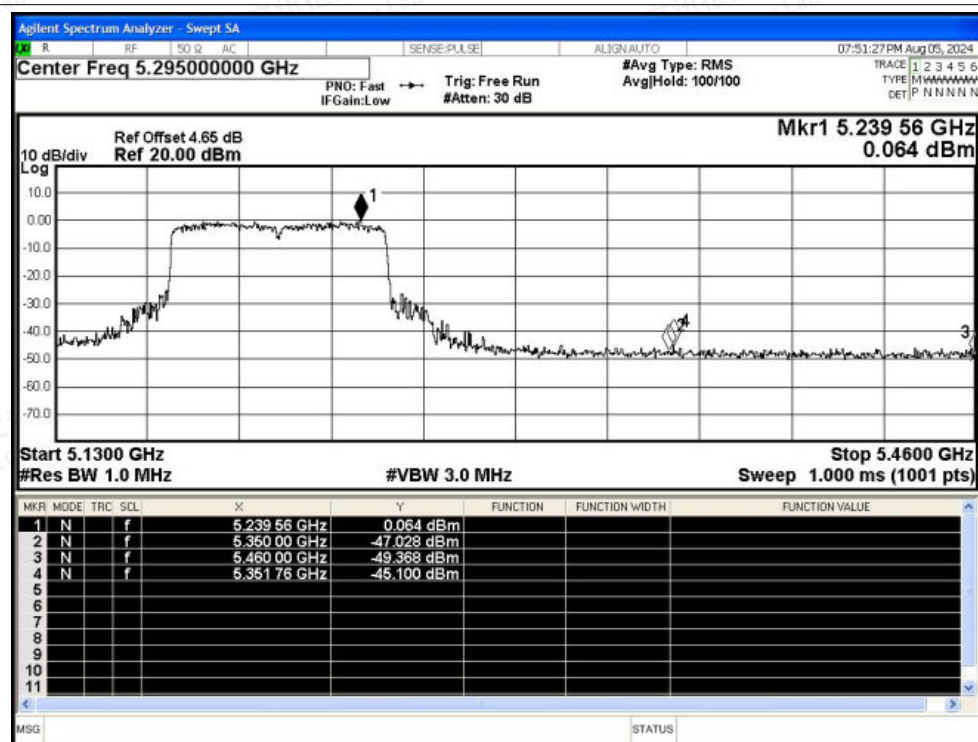

Restrict Band NVNT ac80 5210MHz Ant2 Average

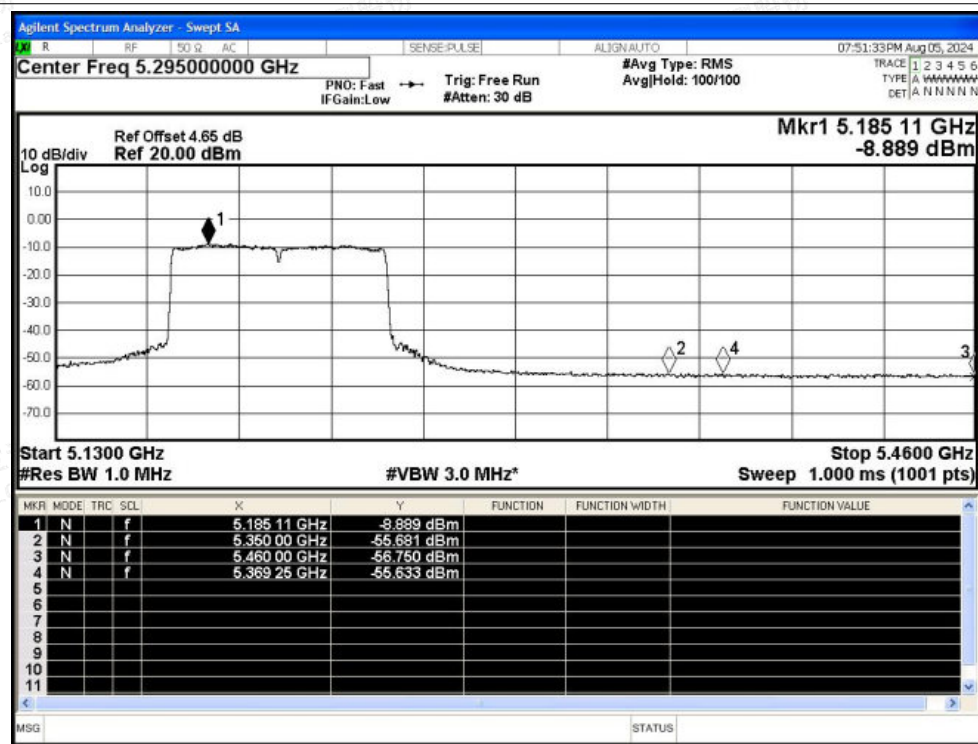

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5210MHz Ant2 Peak

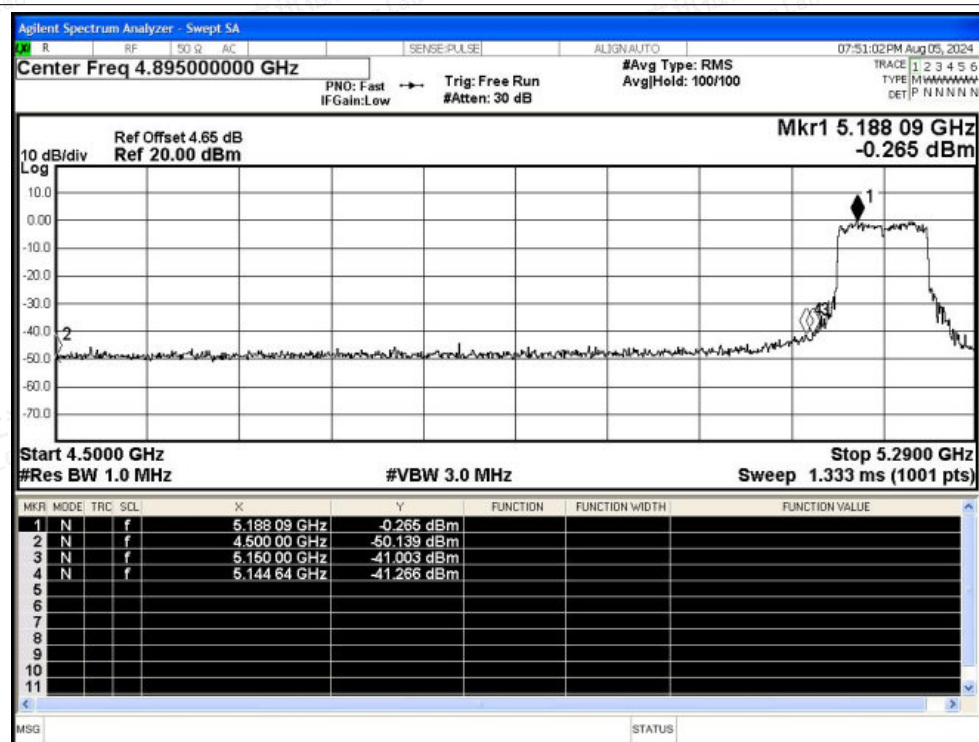

Restrict Band NVNT ac80 5210MHz Ant2 Average

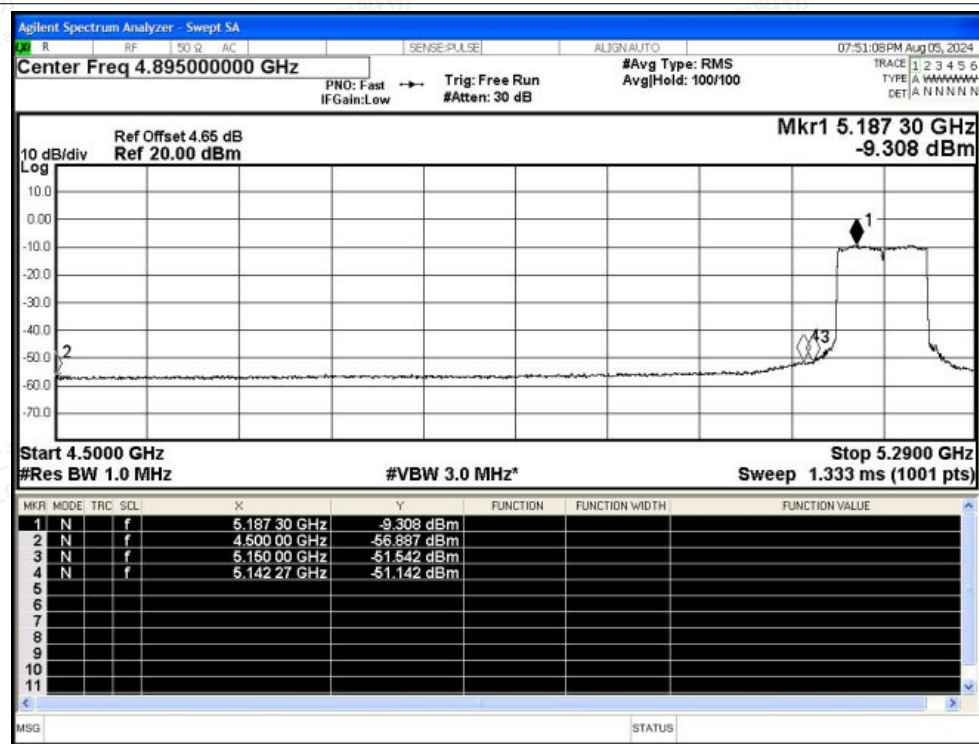

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	n40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5199.98	-20000	-3.85	25	Pass
NVNT	ac20	5240	Ant1	5239.98	-20000	-3.82	25	Pass
NVNT	ac40	5190	Ant1	5190	0	0	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT n40 5190MHz Ant1

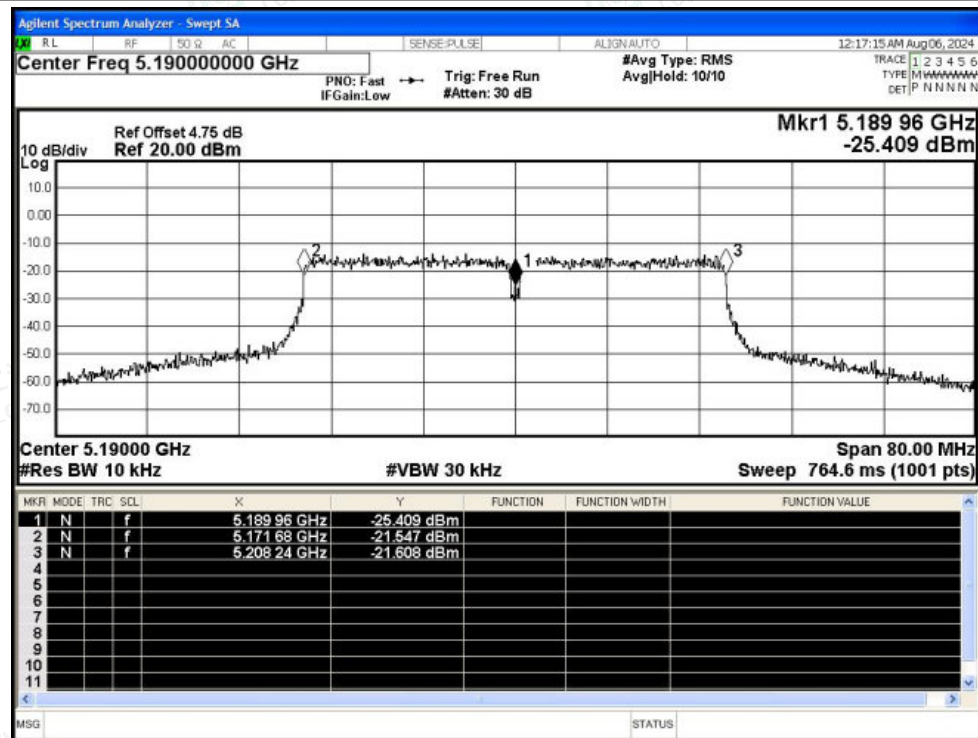

Freq. Stability NVNT n40 5230MHz Ant1

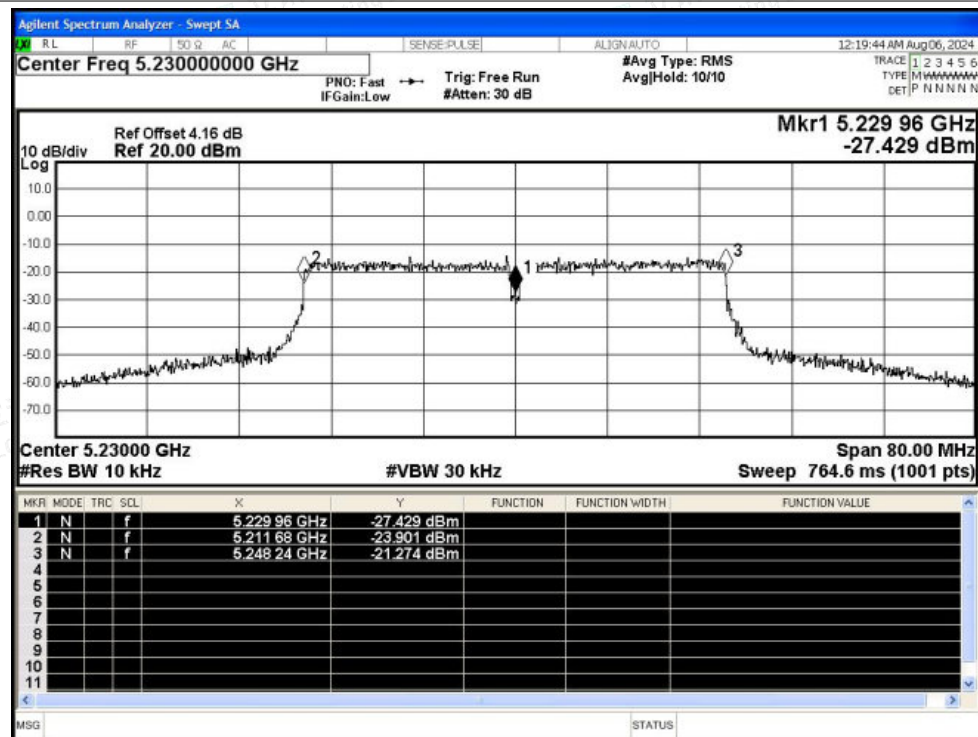

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5180MHz Ant1

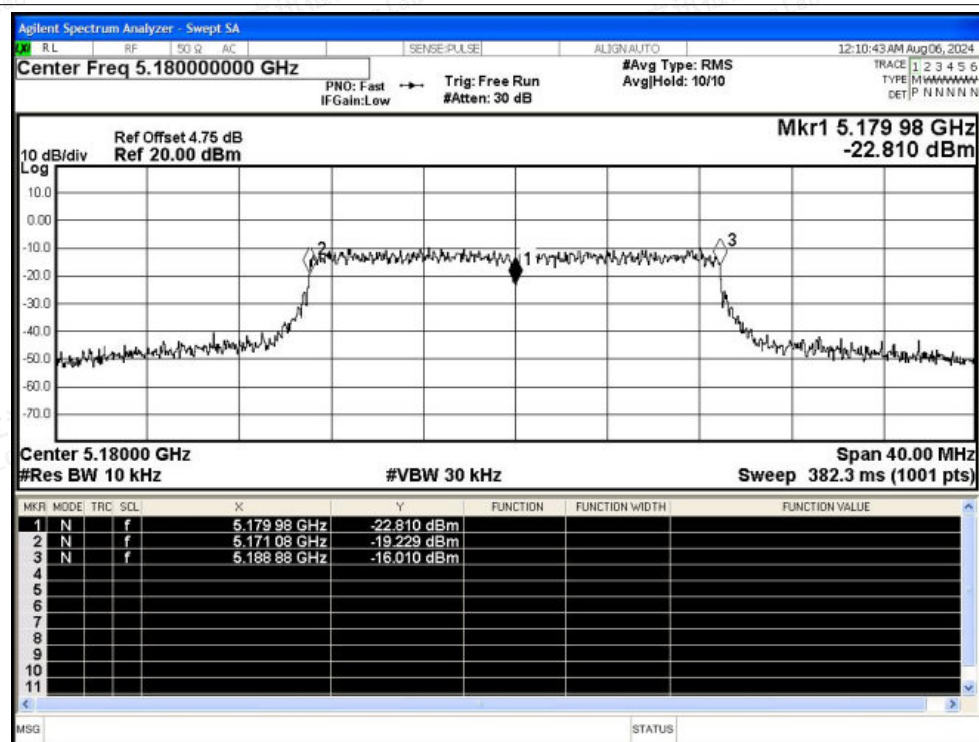

Freq. Stability NVNT ac20 5200MHz Ant1

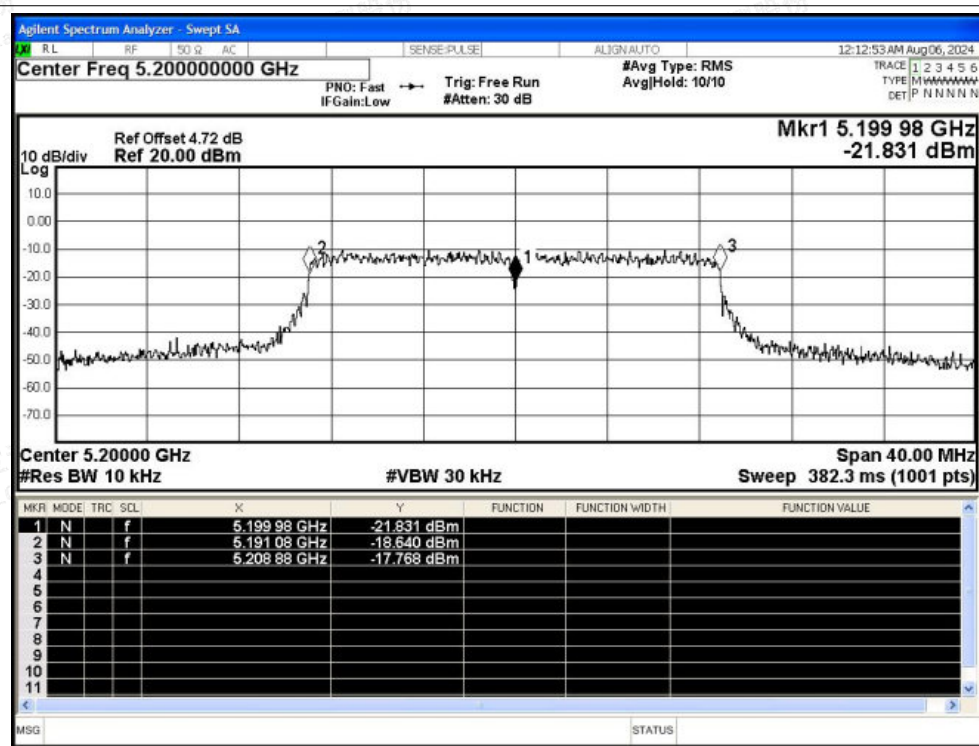

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5240MHz Ant1

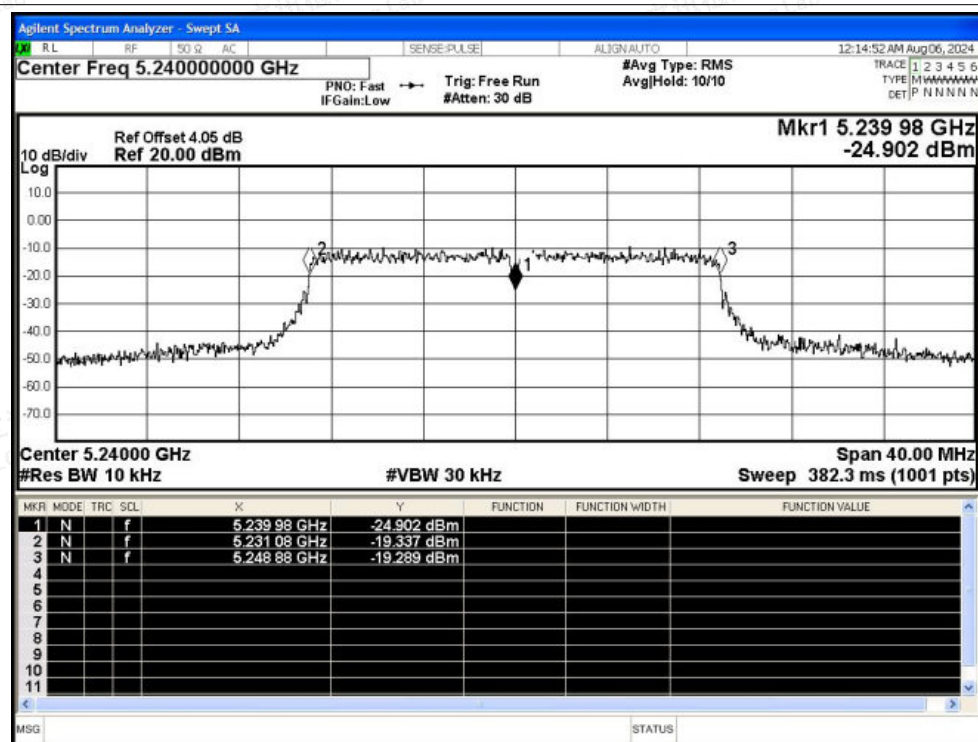

Freq. Stability NVNT ac40 5190MHz Ant1

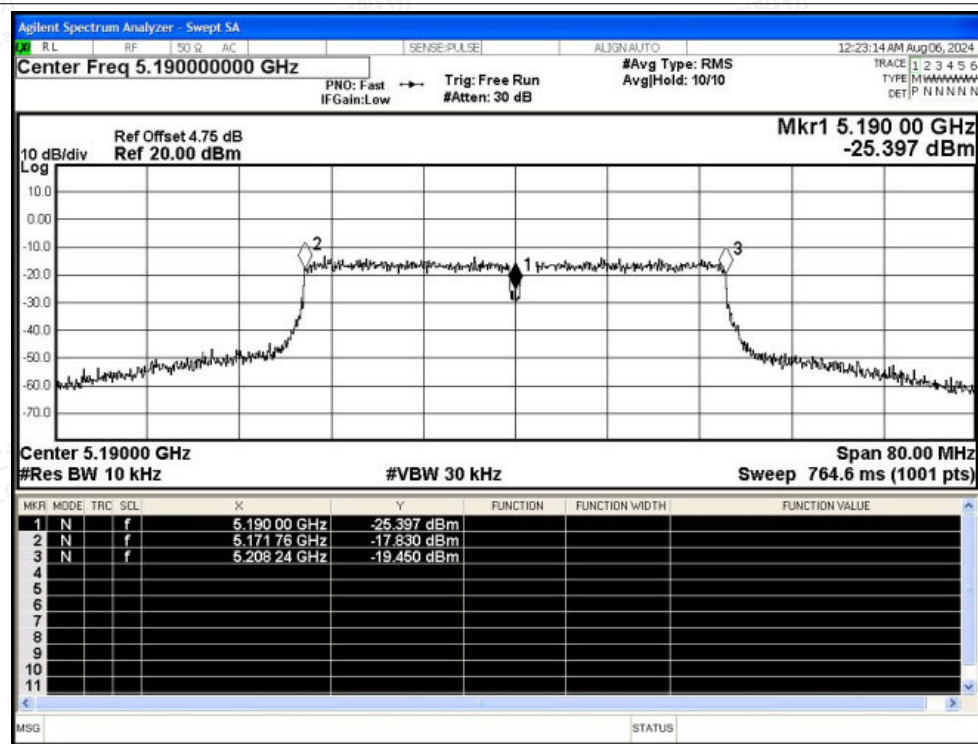

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5230MHz Ant1

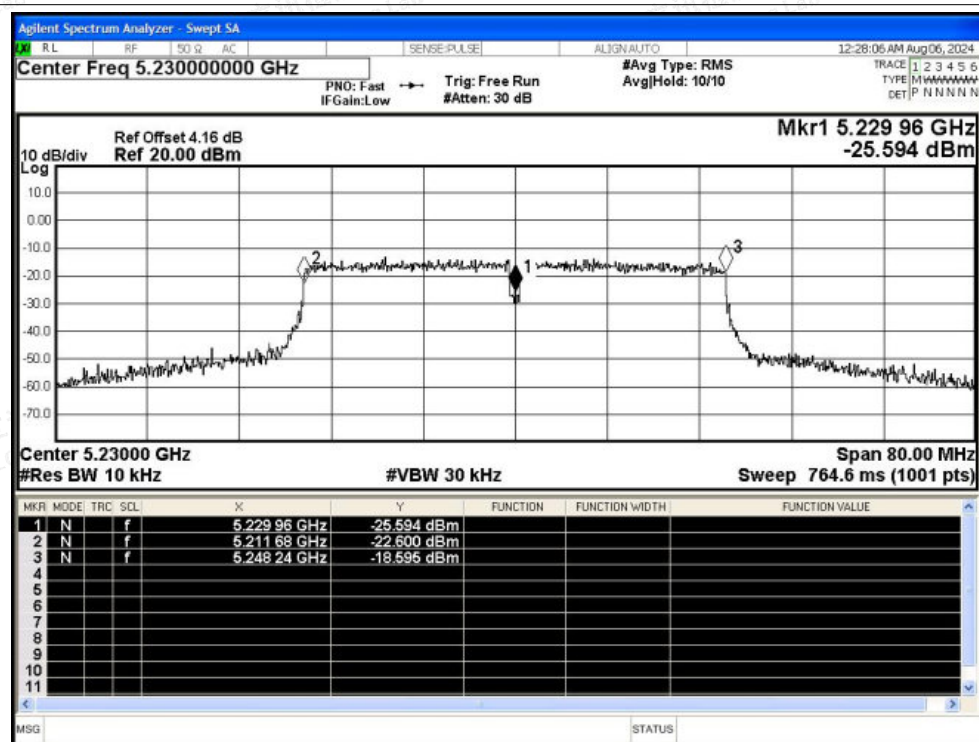

Freq. Stability NVNT ac80 5210MHz Ant1

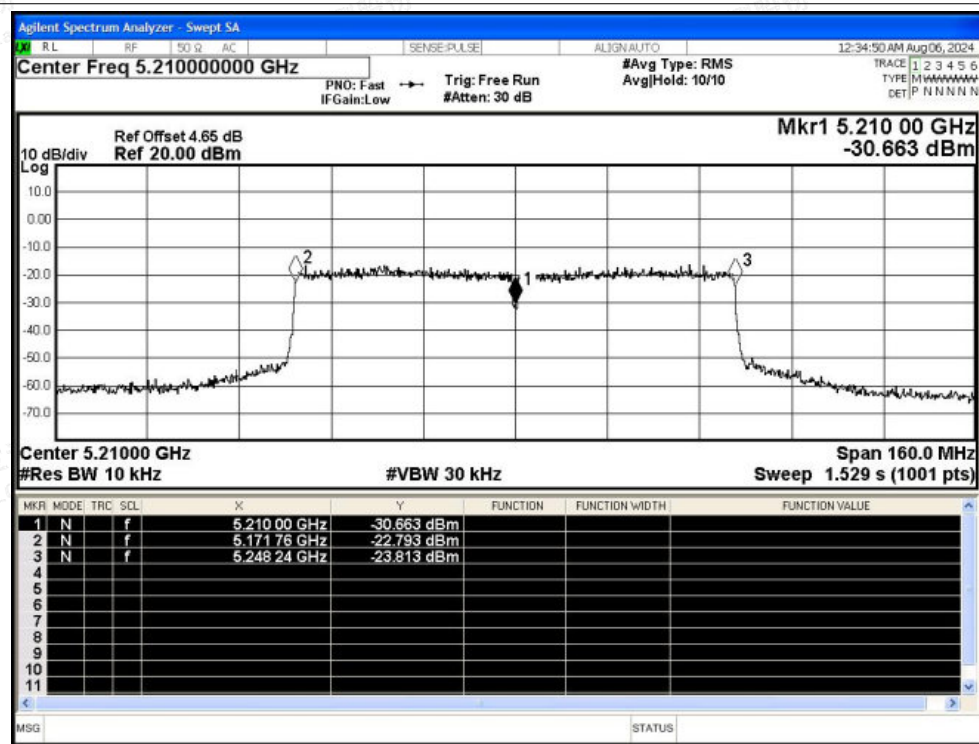

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity