




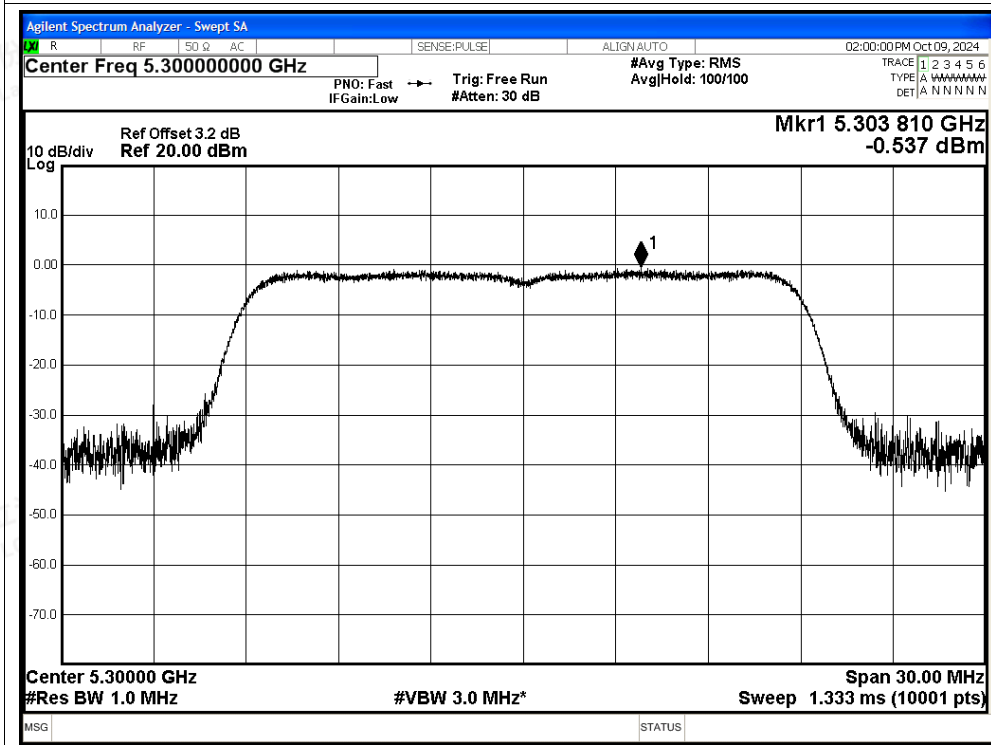
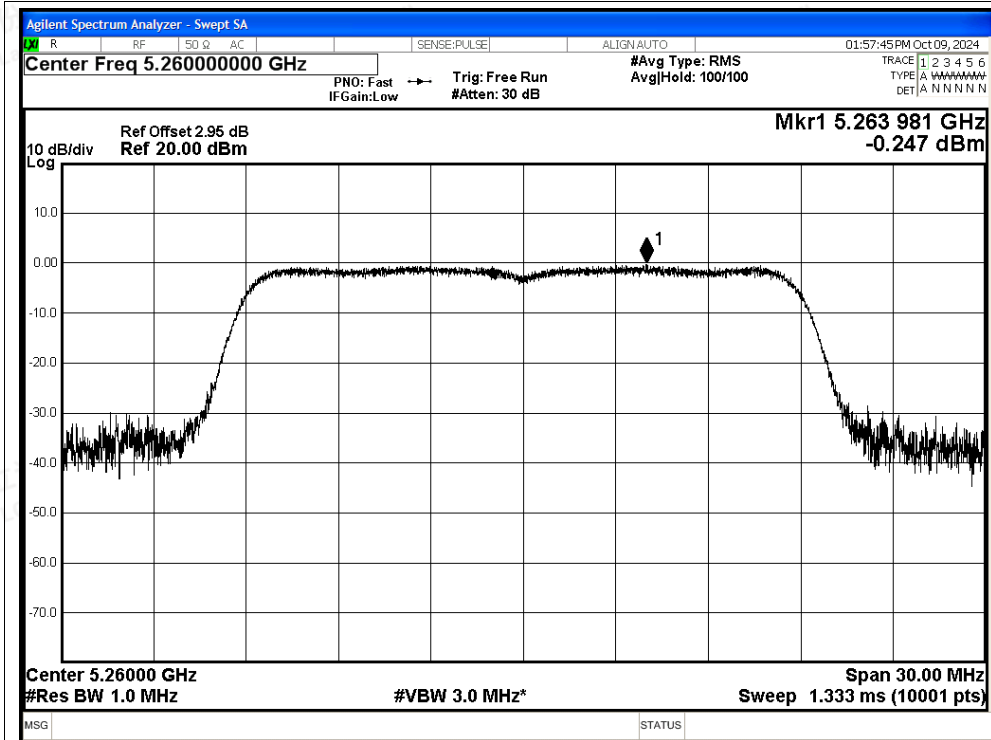
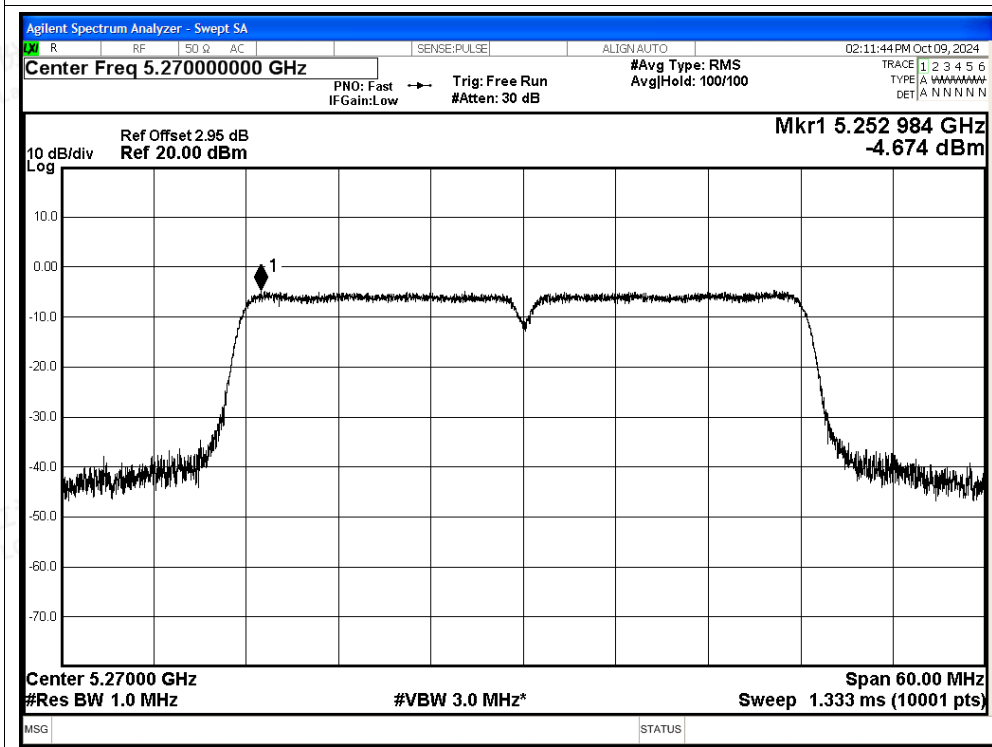
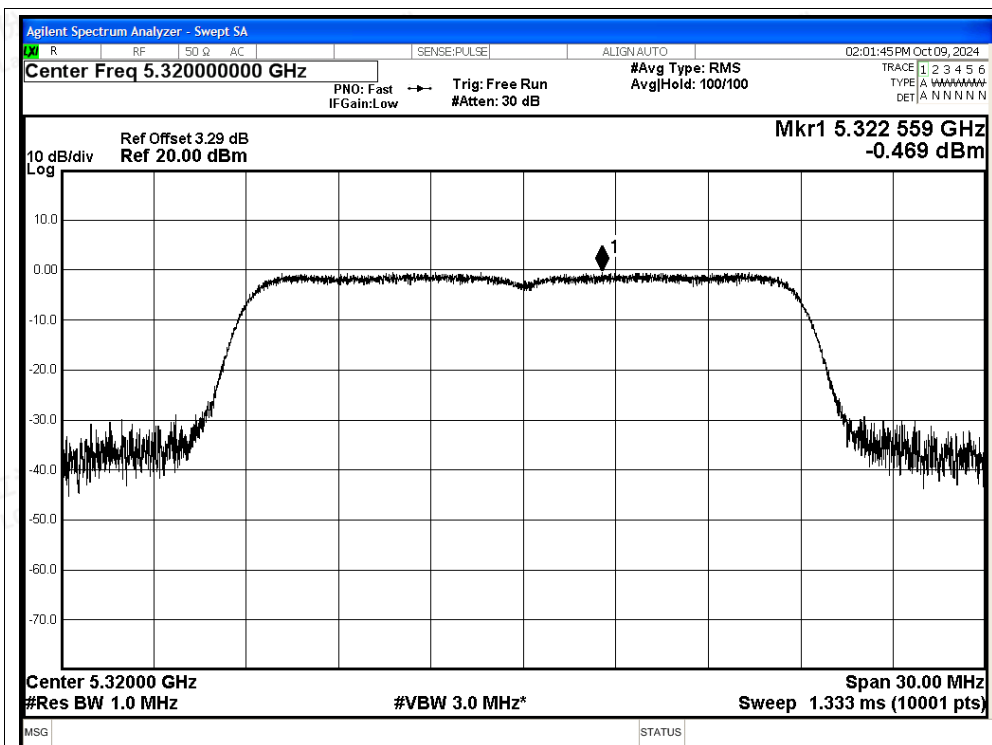
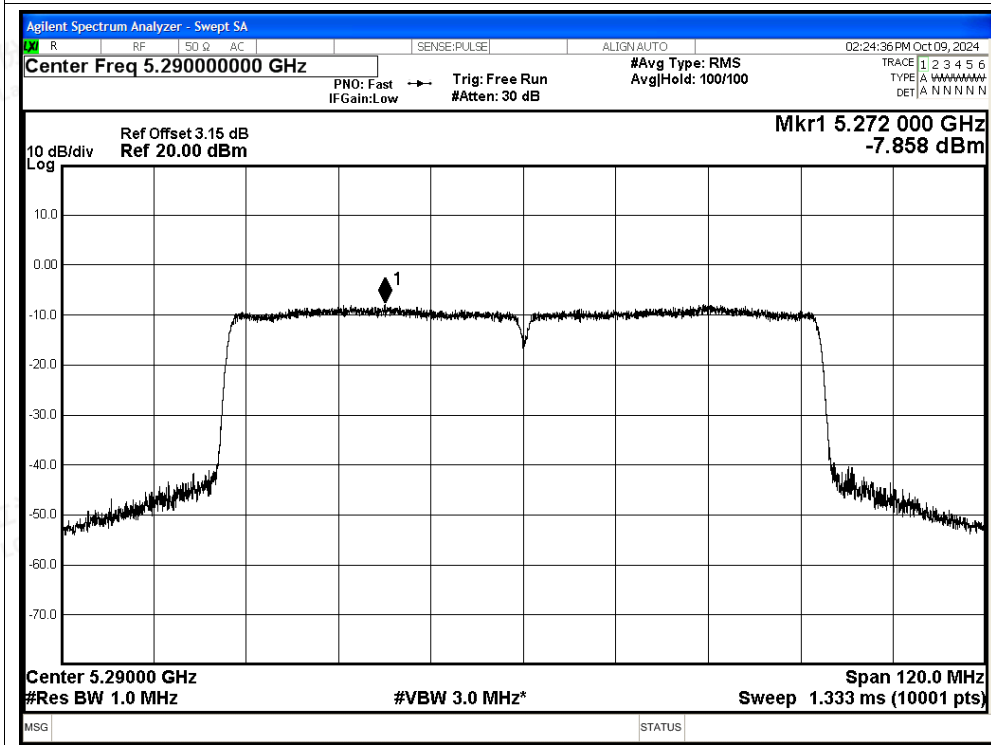



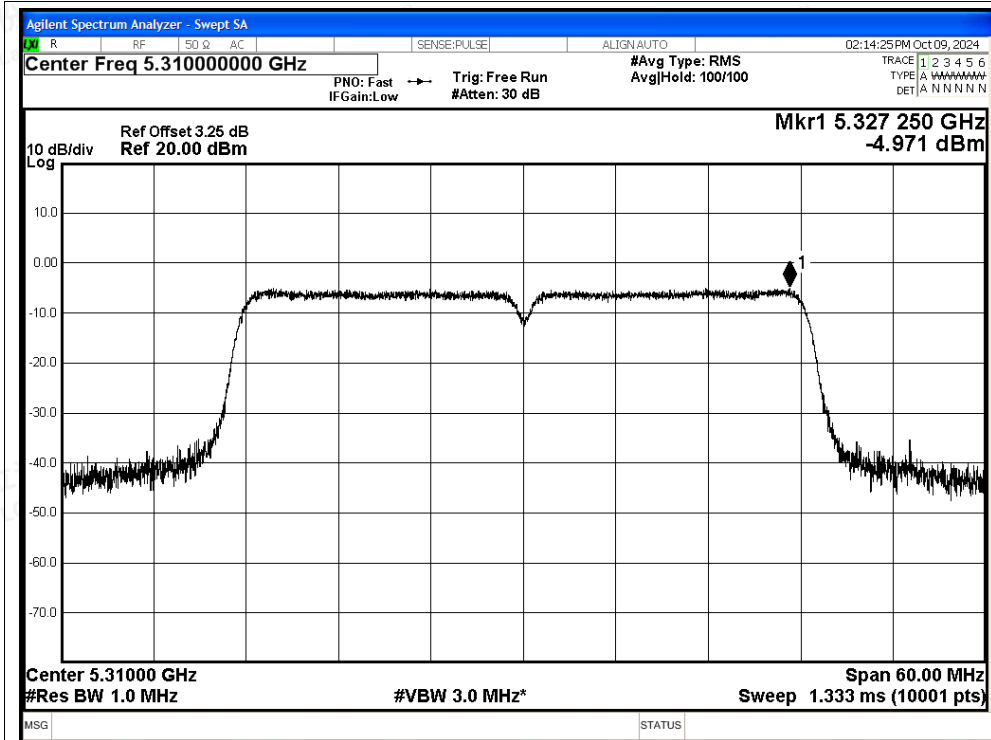



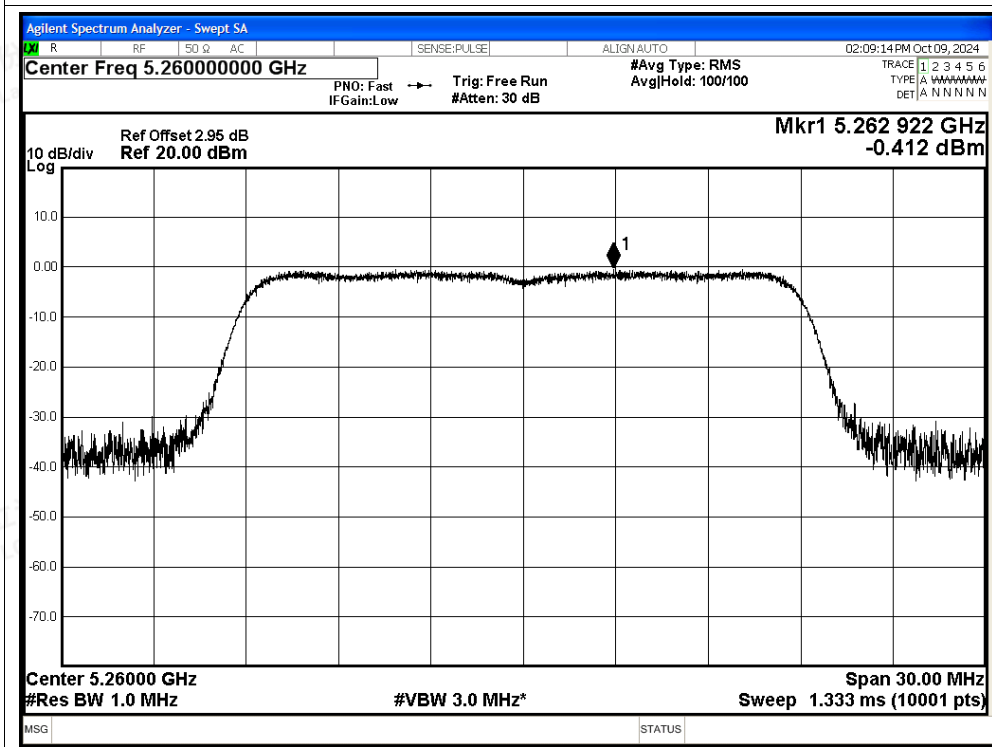


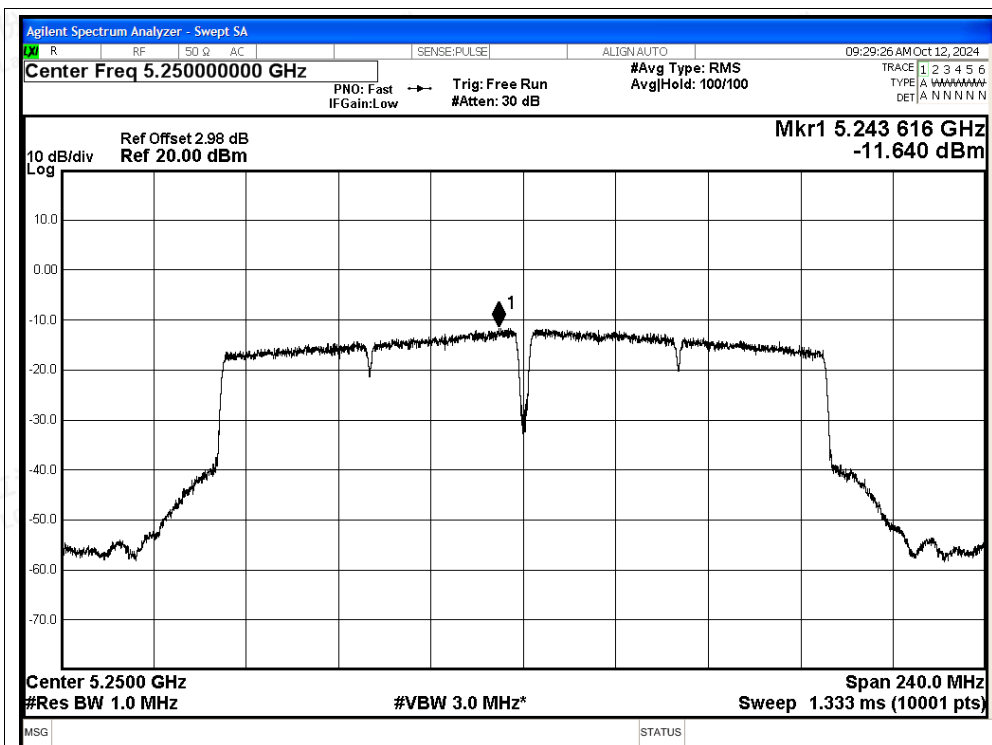

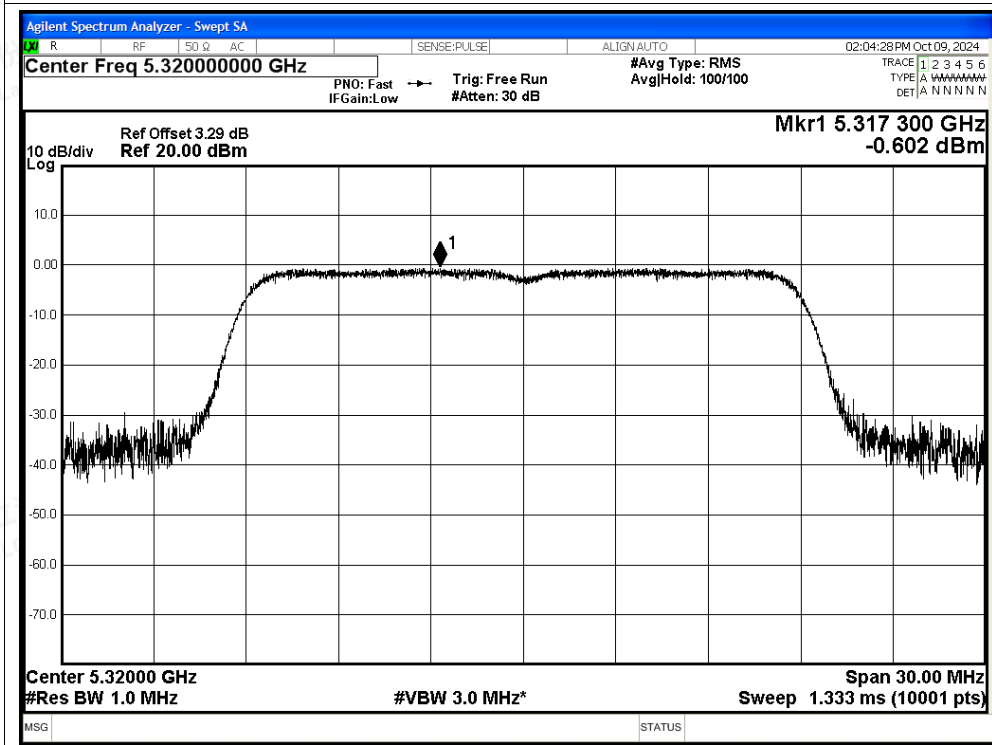

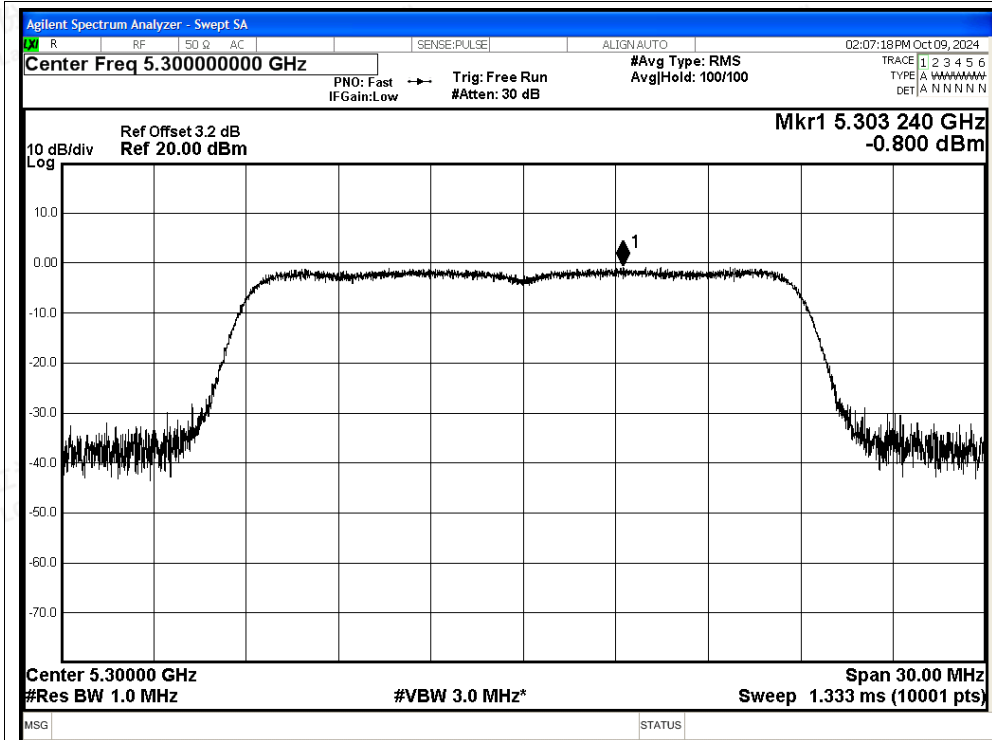

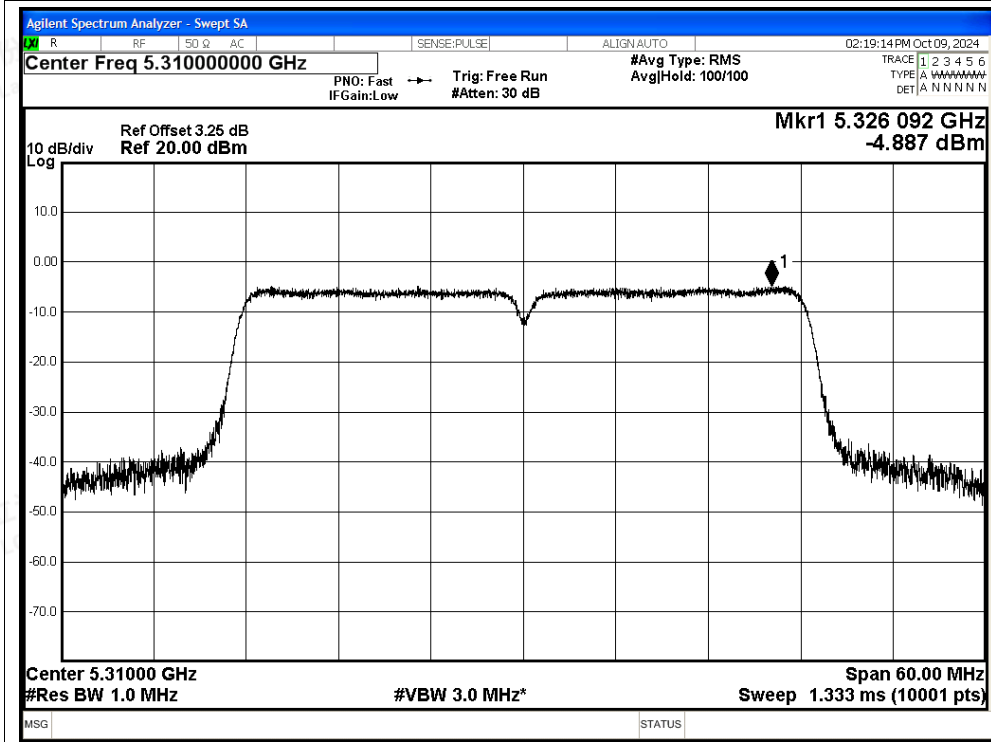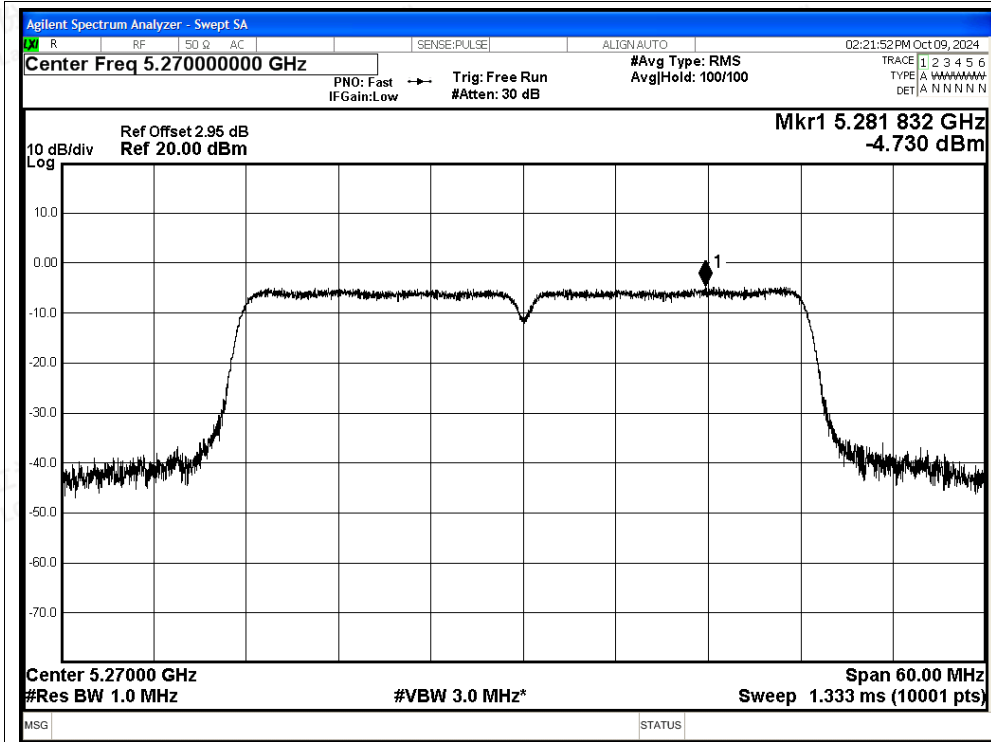


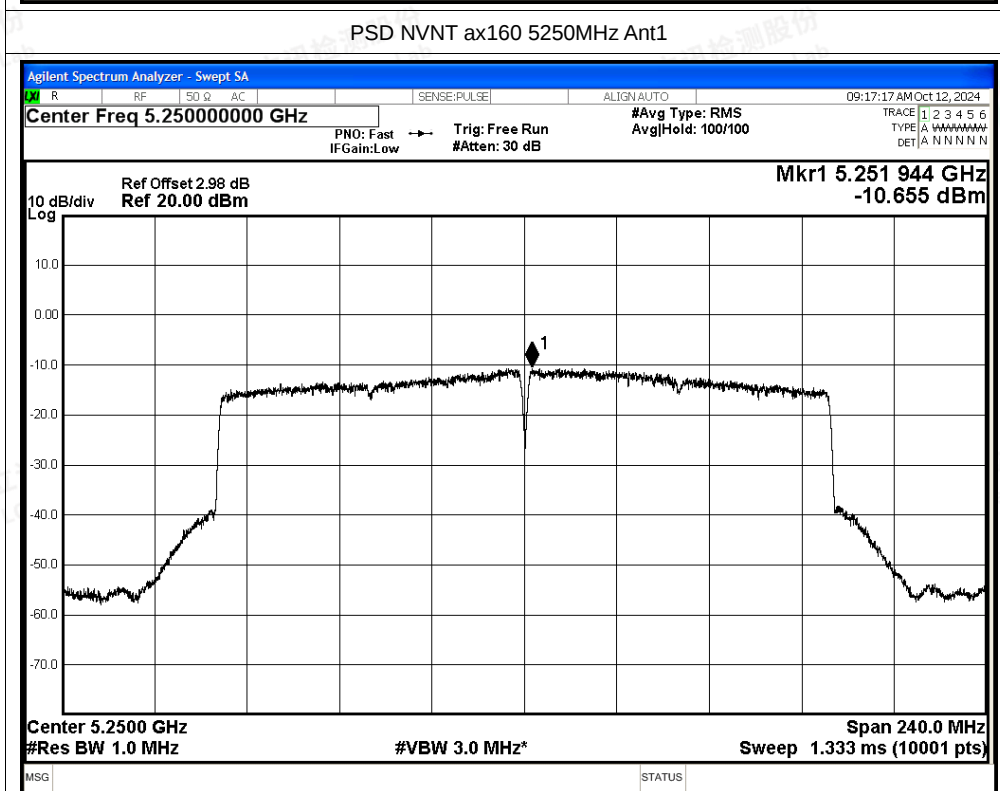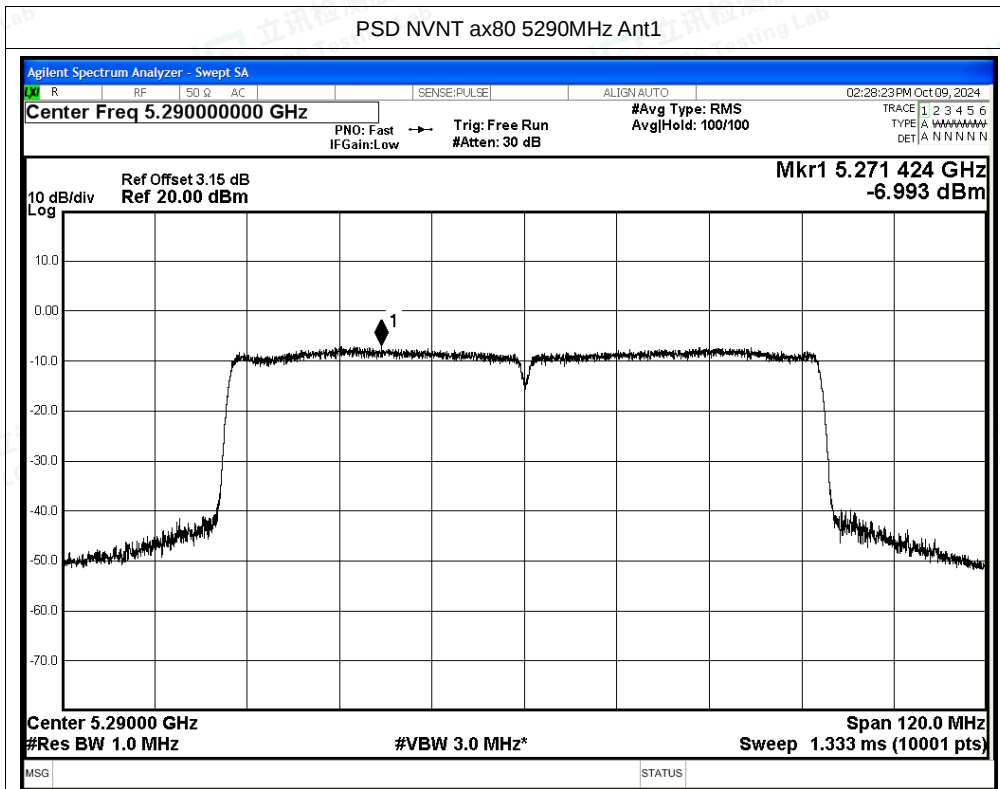




Test Graphs

PSD NVNT a 5260MHz Ant2


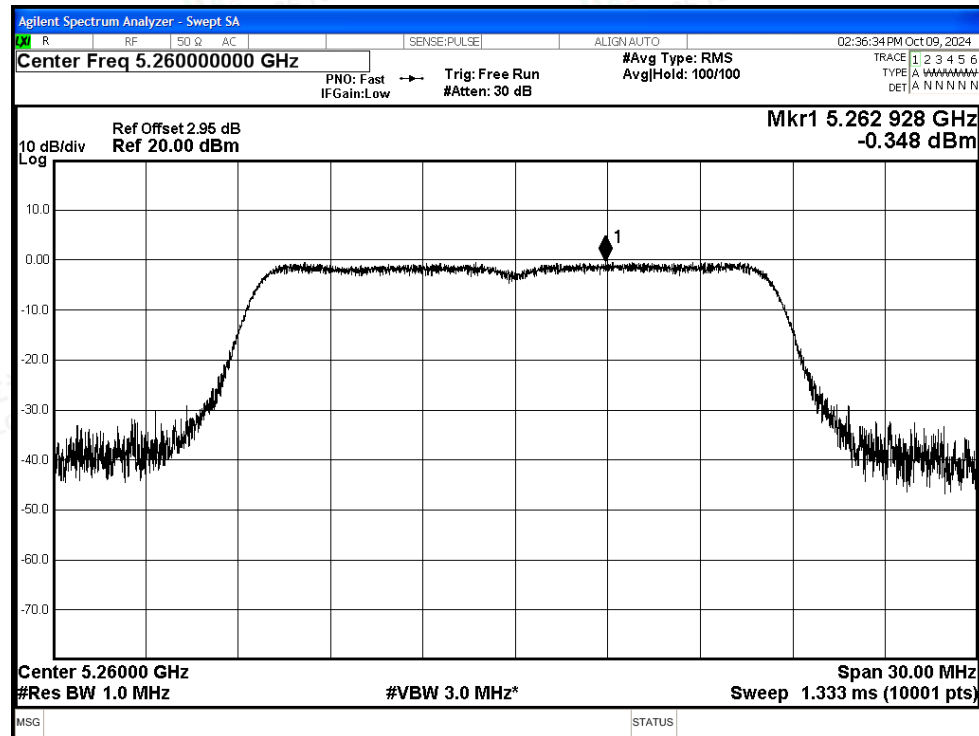




PSD NVNT a 5300MHz Ant2


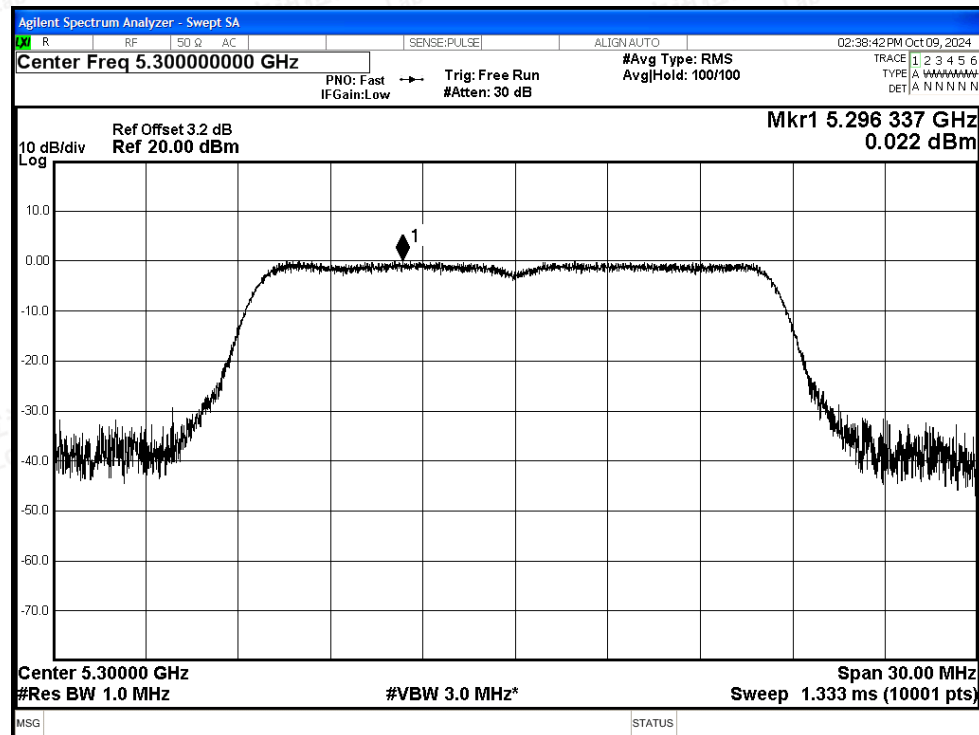




PSD NVNT a 5320MHz Ant2





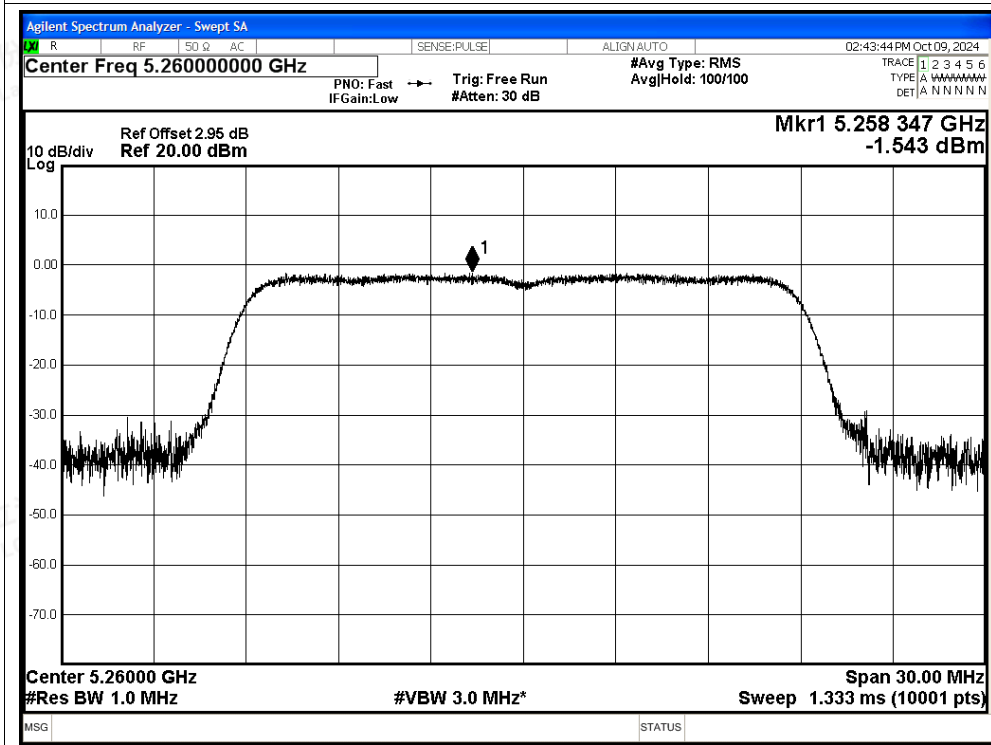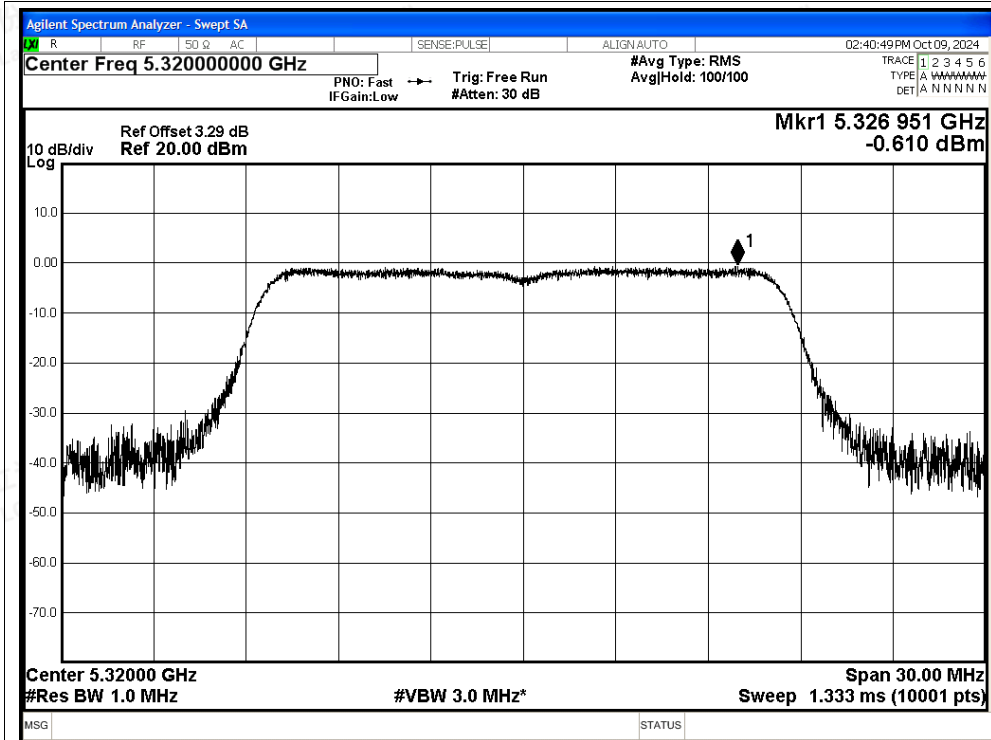

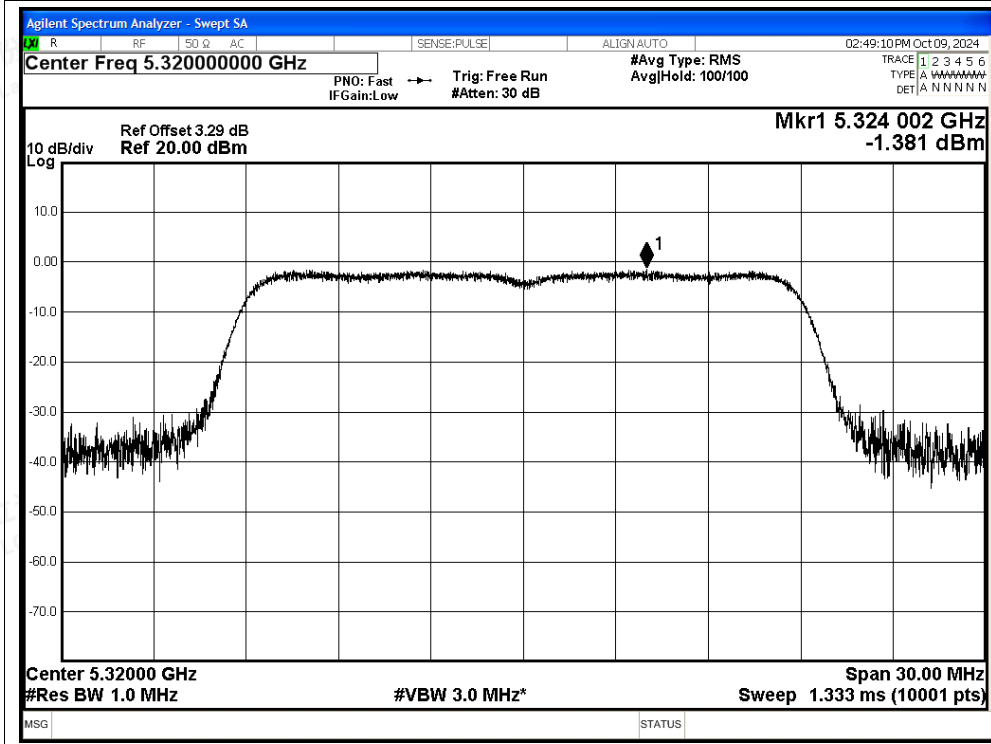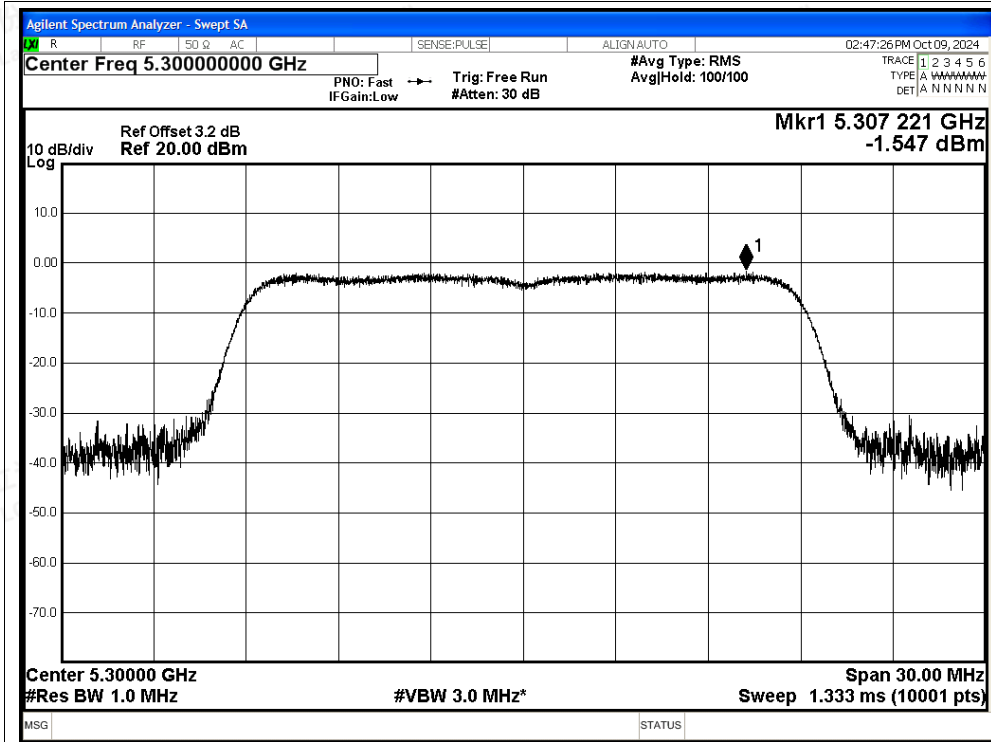

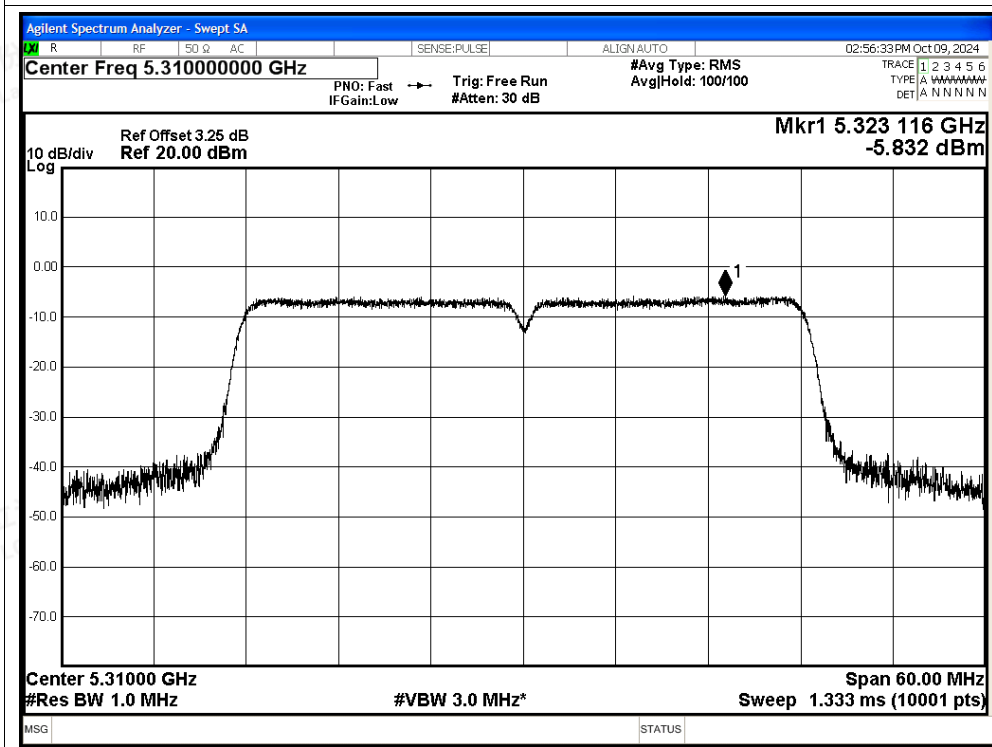
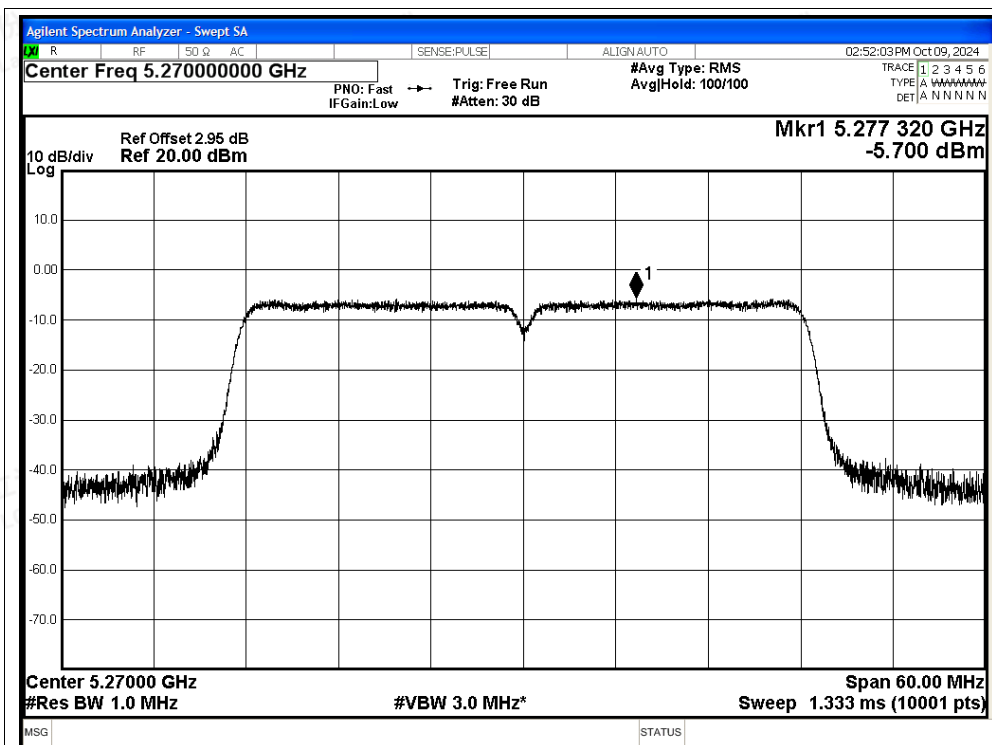


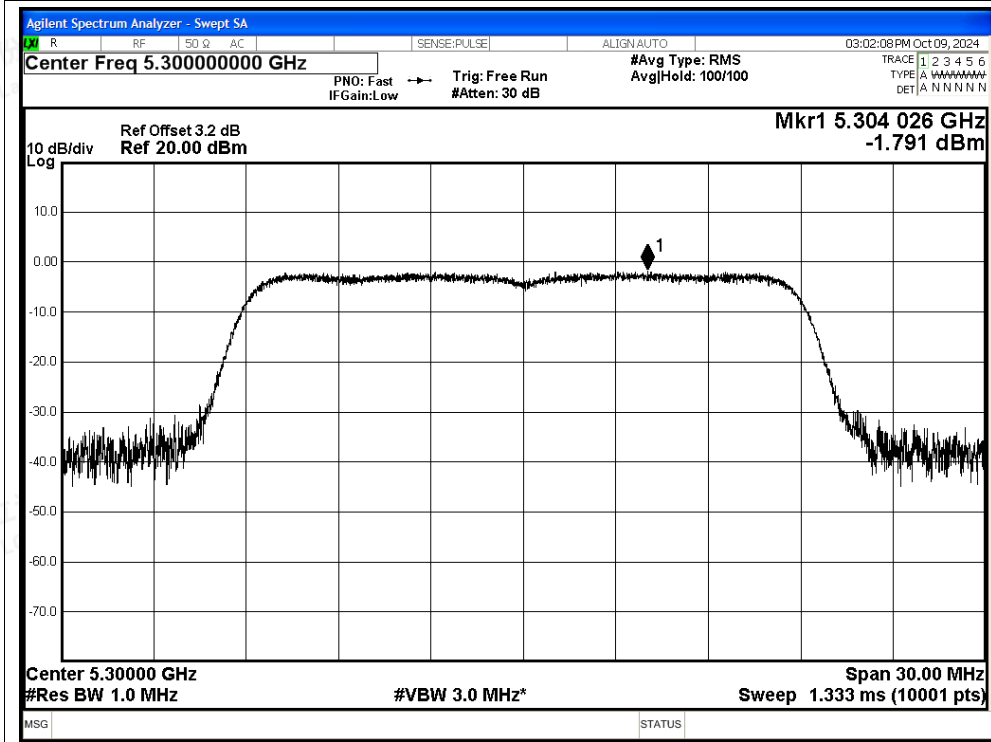
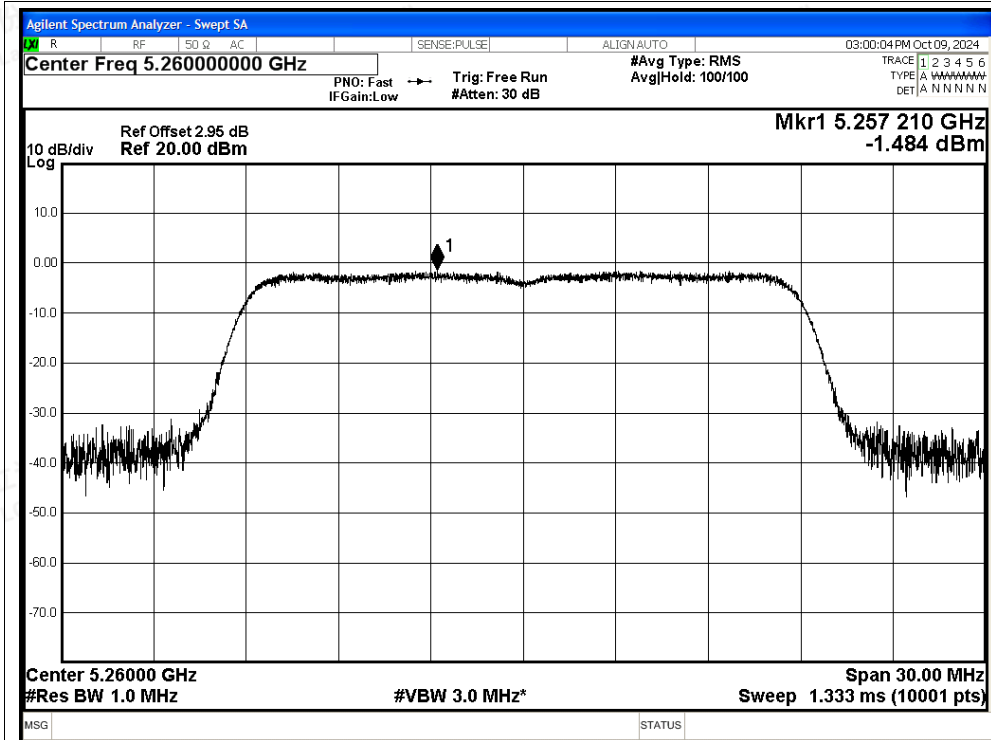


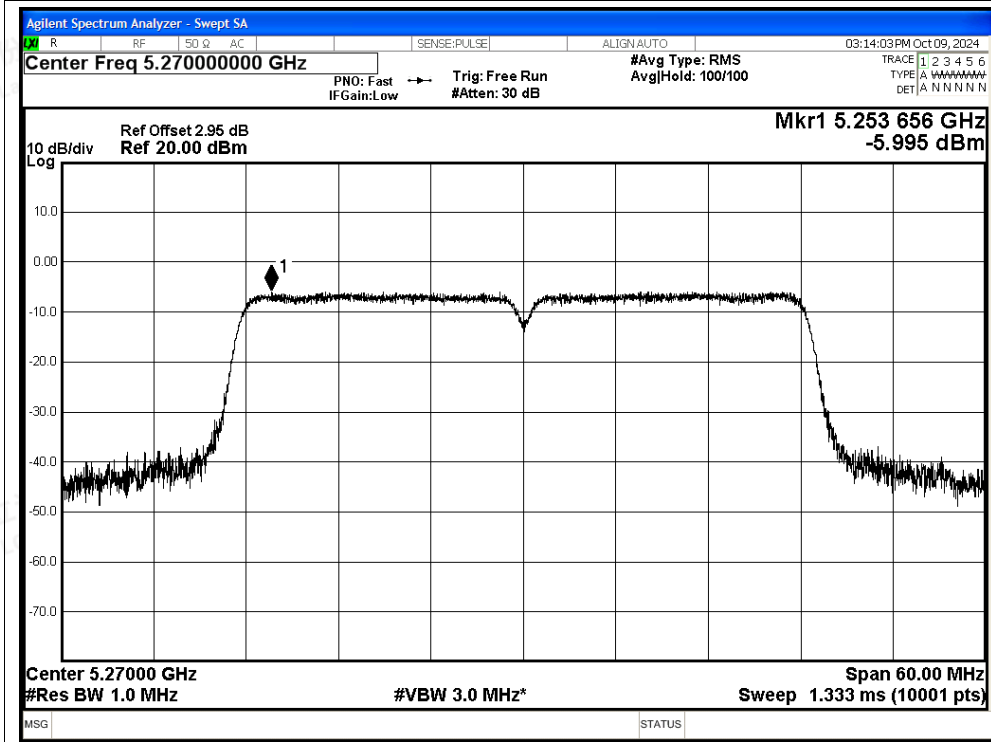
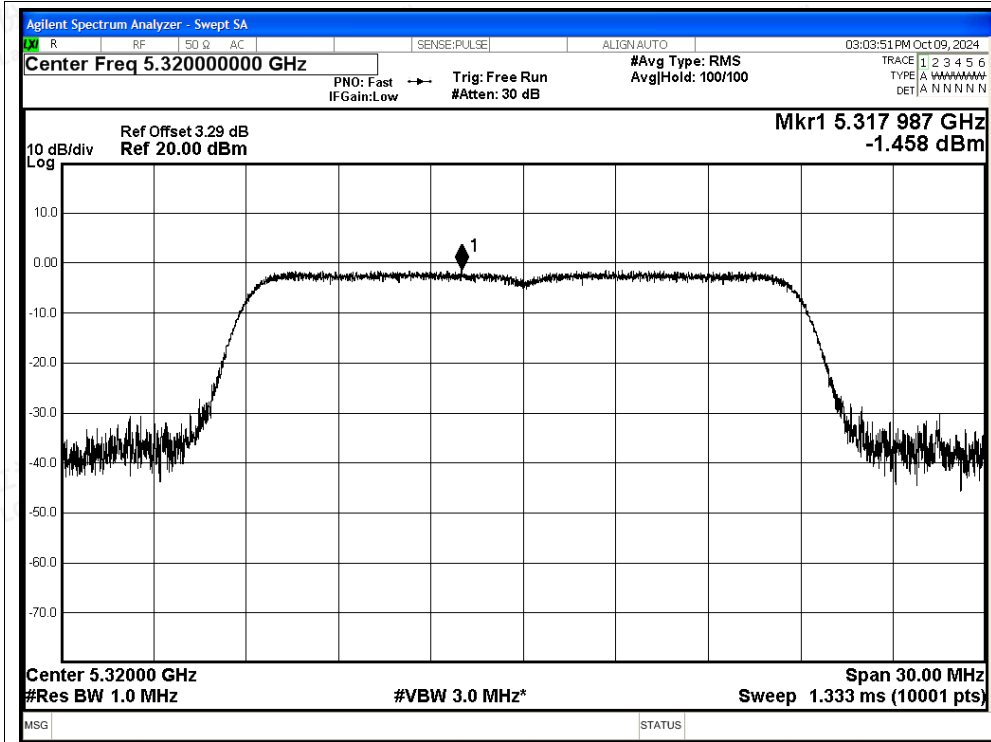




PSD NVNT ac40 5310MHz Ant2





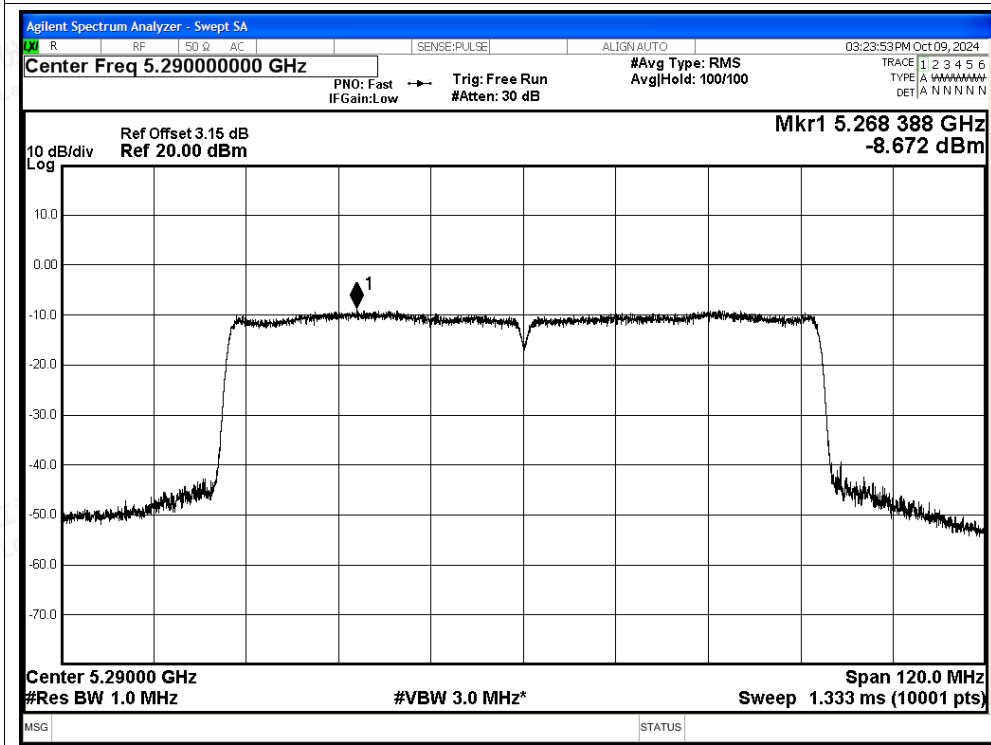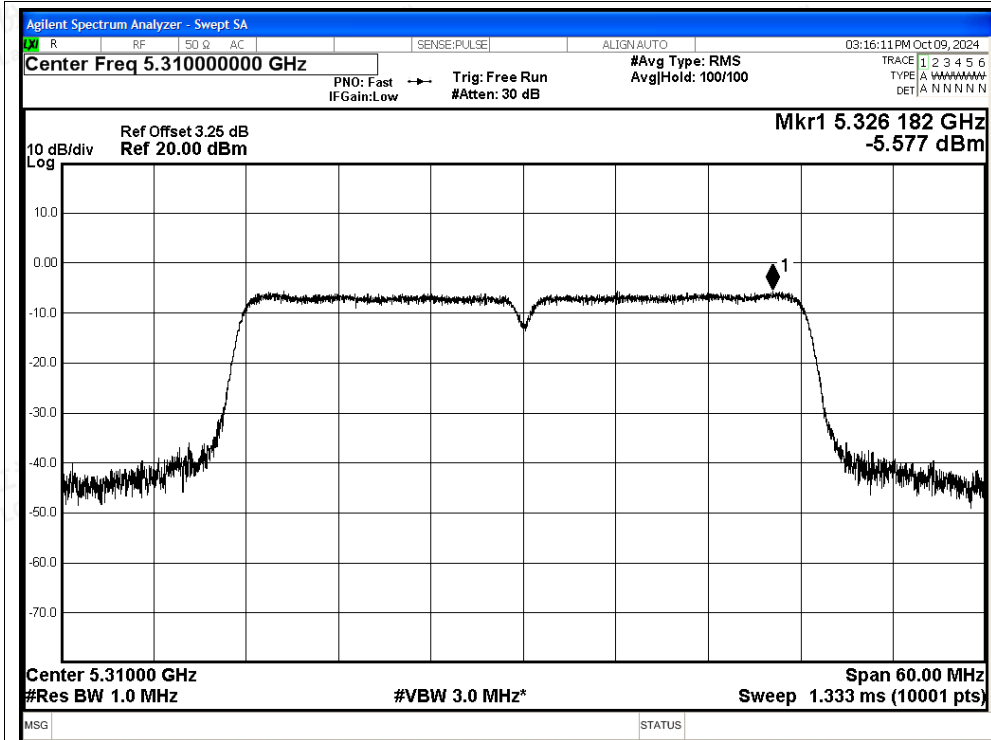

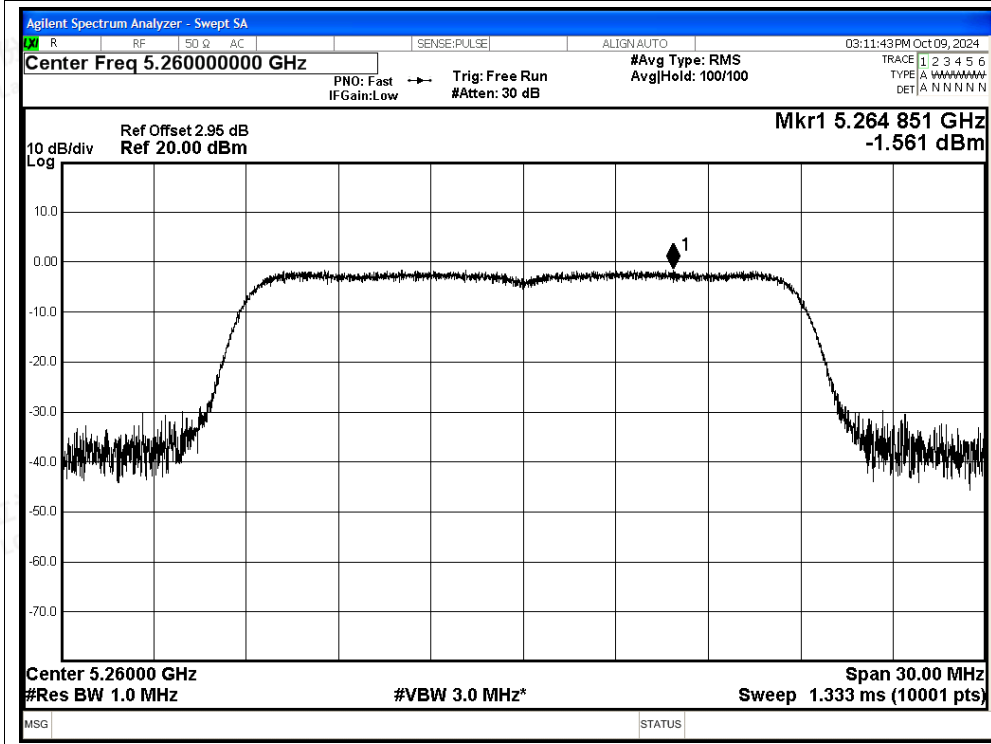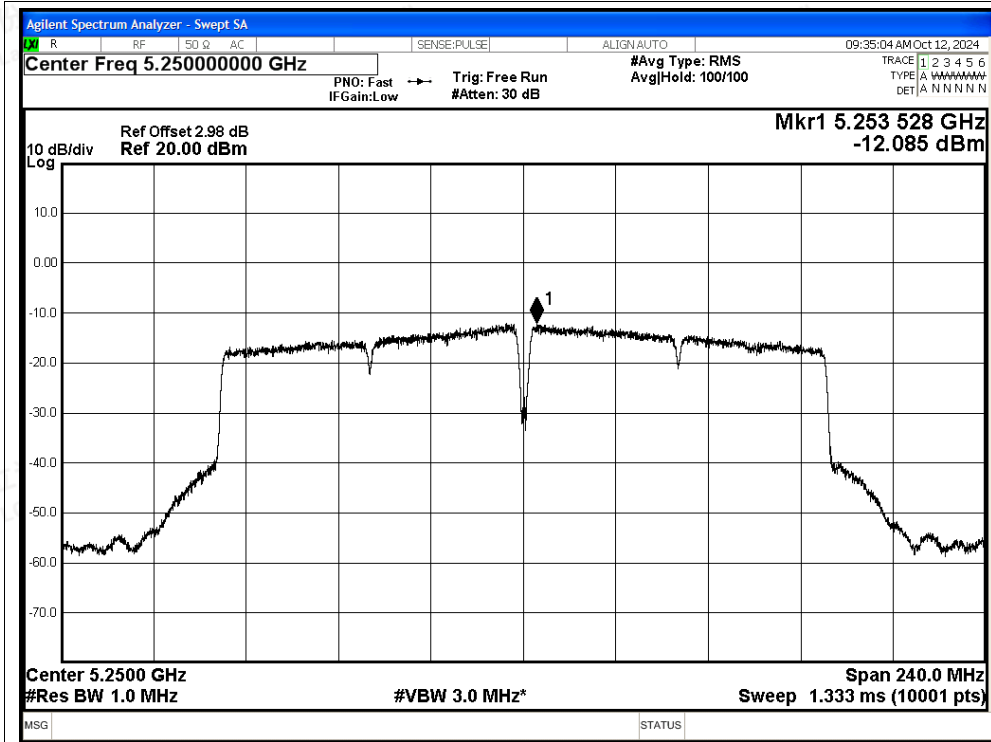

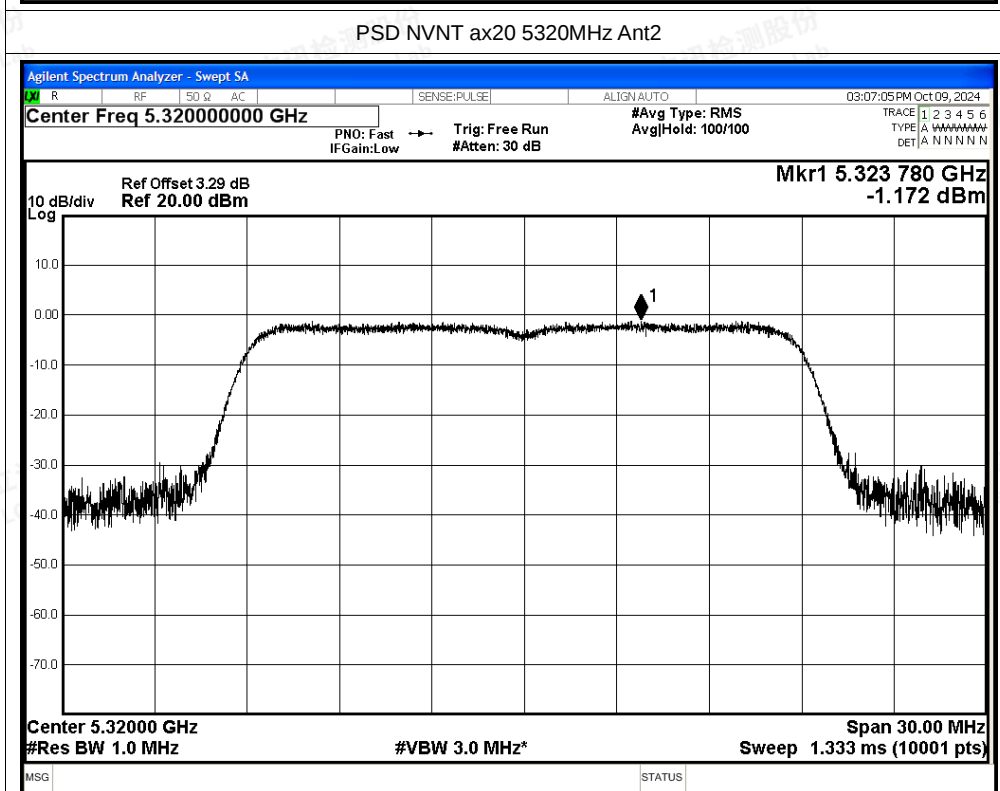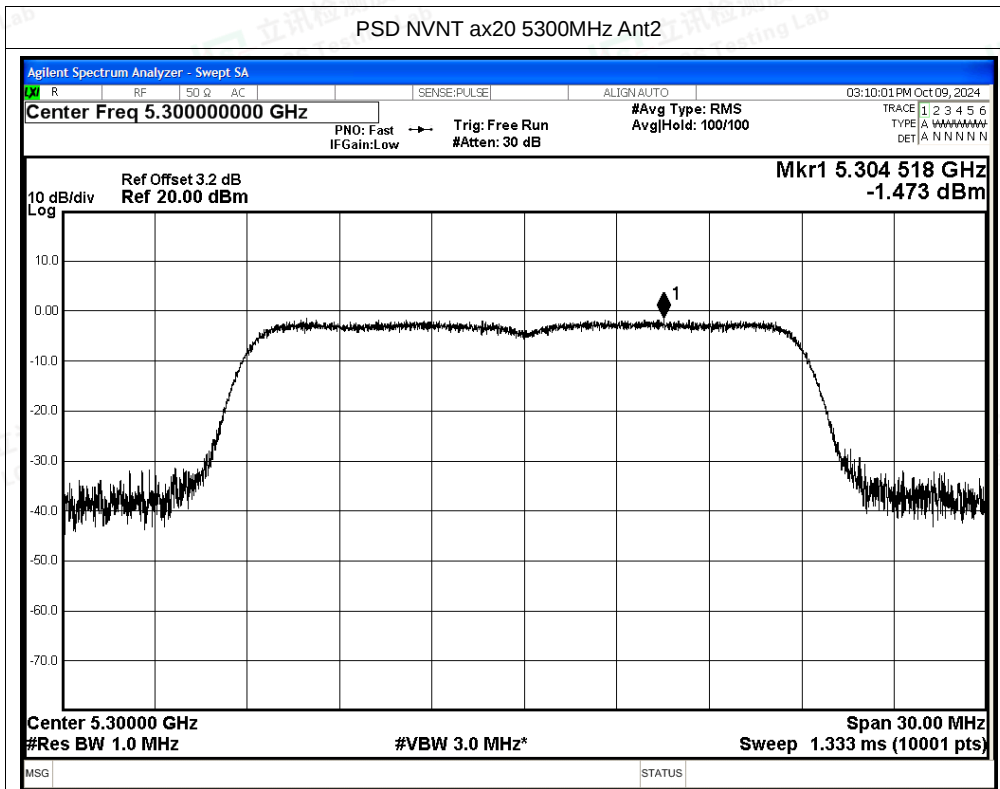

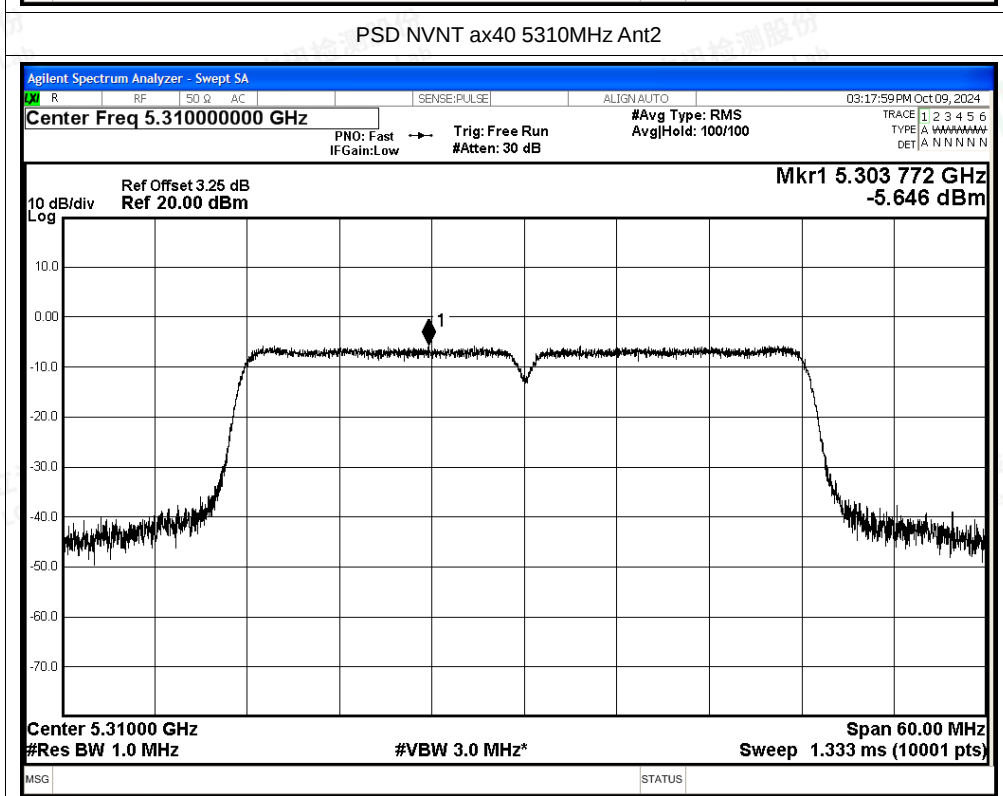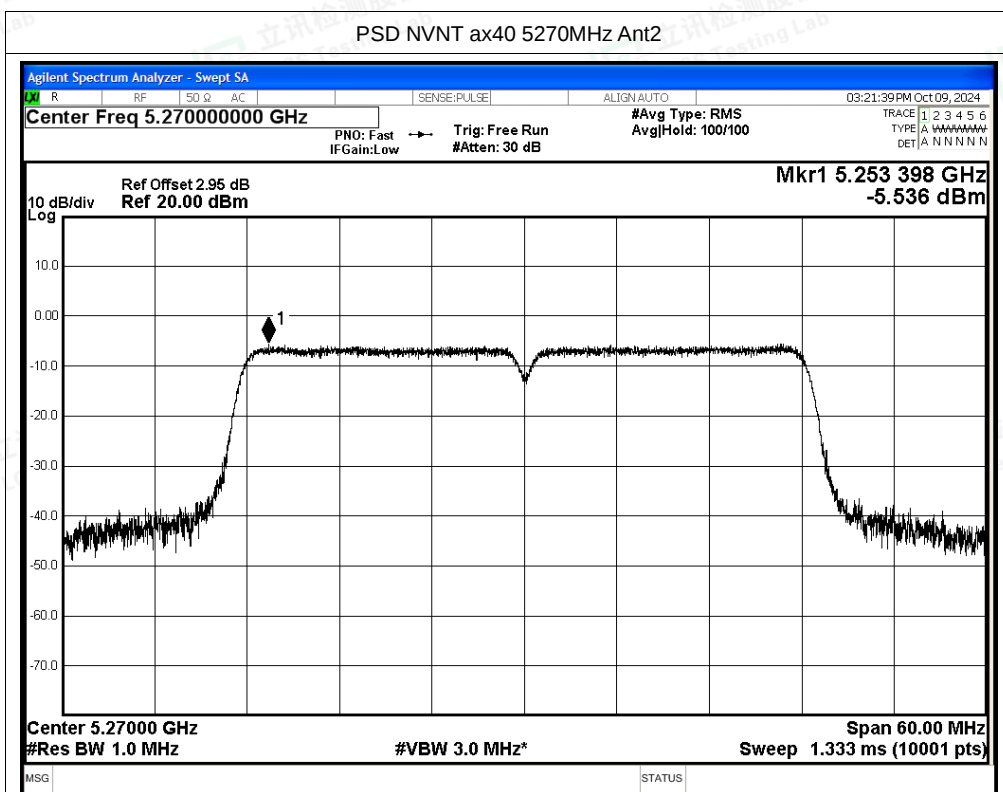

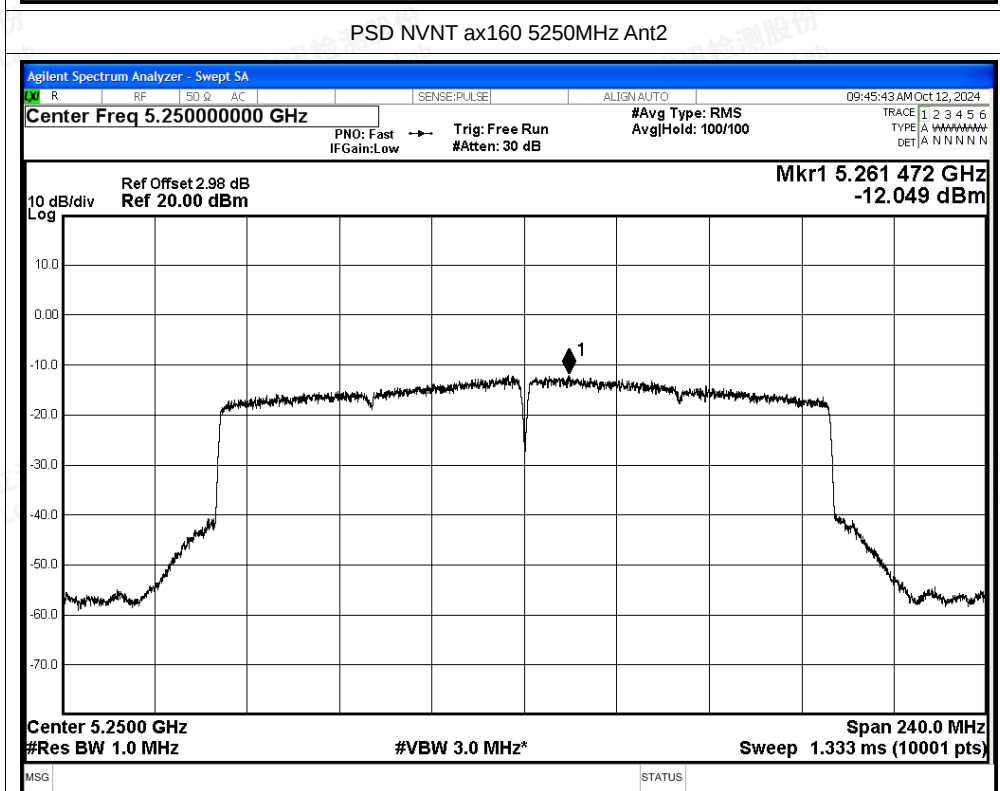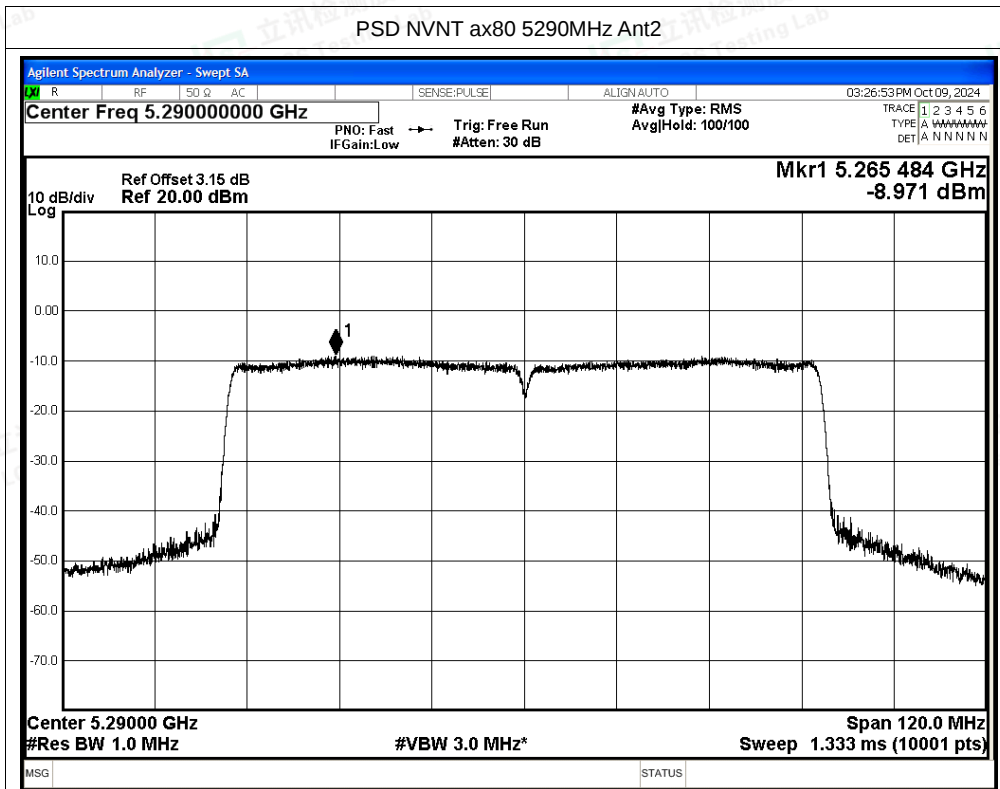



C.4 Restrict Band

Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant0	4500	-50.25	3.09	-	48.07	Peak	68.2	Pass
NVNT	a	5260	Ant0	4500	-59	3.09	0.24	39.56	Average	54	Pass
NVNT	a	5260	Ant0	5129.46	-45.71	3.09	-	52.61	Peak	68.2	Pass
NVNT	a	5260	Ant0	4787.82	-53.96	3.09	0.24	44.6	Average	54	Pass
NVNT	a	5260	Ant0	5150	-47.1	3.09	-	51.22	Peak	68.2	Pass
NVNT	a	5260	Ant0	5150	-56.04	3.09	0.24	42.52	Average	54	Pass
NVNT	a	5320	Ant0	5350	-41.71	3.09	-	56.61	Peak	68.2	Pass
NVNT	a	5320	Ant0	5350	-53.25	3.09	0.24	45.31	Average	54	Pass
NVNT	a	5320	Ant0	5350.4	-38.16	3.09	-	60.16	Peak	68.2	Pass
NVNT	a	5320	Ant0	5352.2	-52.9	3.09	0.24	45.66	Average	54	Pass
NVNT	a	5320	Ant0	5460	-49.81	3.09	-	48.51	Peak	68.2	Pass
NVNT	a	5320	Ant0	5460	-57.62	3.09	0.24	40.94	Average	54	Pass
NVNT	n20	5260	Ant0	4500	-49.44	3.09	-	48.88	Peak	68.2	Pass
NVNT	n20	5260	Ant0	4500	-59.04	3.09	0.12	39.4	Average	54	Pass
NVNT	n20	5260	Ant0	4787.82	-45.24	3.09	-	53.08	Peak	68.2	Pass
NVNT	n20	5260	Ant0	4772.22	-54.76	3.09	0.12	43.68	Average	54	Pass
NVNT	n20	5260	Ant0	5150	-49.19	3.09	-	49.13	Peak	68.2	Pass
NVNT	n20	5260	Ant0	5150	-56.74	3.09	0.12	41.7	Average	54	Pass
NVNT	n20	5320	Ant0	5350	-45.27	3.09	-	53.05	Peak	68.2	Pass
NVNT	n20	5320	Ant0	5350	-54.94	3.09	0.12	43.5	Average	54	Pass
NVNT	n20	5320	Ant0	5350.4	-40.61	3.09	-	57.71	Peak	68.2	Pass
NVNT	n20	5320	Ant0	5350	-54.94	3.09	0.12	43.5	Average	54	Pass
NVNT	n20	5320	Ant0	5460	-48.98	3.09	-	49.34	Peak	68.2	Pass
NVNT	n20	5320	Ant0	5460	-57.97	3.09	0.12	40.47	Average	54	Pass
NVNT	n40	5270	Ant0	4500	-51.7	3.09	-	46.62	Peak	68.2	Pass
NVNT	n40	5270	Ant0	4500	-58.59	3.09	0.12	39.85	Average	54	Pass
NVNT	n40	5270	Ant0	4806.99	-46.58	3.09	-	51.74	Peak	68.2	Pass
NVNT	n40	5270	Ant0	4806.99	-55.1	3.09	0.12	43.34	Average	54	Pass
NVNT	n40	5270	Ant0	5150	-47.9	3.09	-	50.42	Peak	68.2	Pass
NVNT	n40	5270	Ant0	5150	-57.4	3.09	0.12	41.04	Average	54	Pass
NVNT	n40	5310	Ant0	5350	-46.87	3.09	-	51.45	Peak	68.2	Pass
NVNT	n40	5310	Ant0	5350	-57.18	3.09	0.12	41.26	Average	54	Pass
NVNT	n40	5310	Ant0	5350.6	-45.1	3.09	-	53.22	Peak	68.2	Pass
NVNT	n40	5310	Ant0	5350.2	-56.7	3.09	0.12	41.74	Average	54	Pass
NVNT	n40	5310	Ant0	5460	-50.32	3.09	-	48	Peak	68.2	Pass
NVNT	n40	5310	Ant0	5460	-57.98	3.09	0.12	40.46	Average	54	Pass
NVNT	ac20	5260	Ant0	4500	-50.44	3.09	-	47.88	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant0	4500	-58.69	3.09	0.12	39.75	Average	54	Pass
NVNT	ac20	5260	Ant0	4773	-44.36	3.09	-	53.96	Peak	68.2	Pass
NVNT	ac20	5260	Ant0	4787.82	-54.3	3.09	0.12	44.14	Average	54	Pass
NVNT	ac20	5260	Ant0	5150	-47.55	3.09	-	50.77	Peak	68.2	Pass
NVNT	ac20	5260	Ant0	5150	-56.25	3.09	0.12	42.19	Average	54	Pass
NVNT	ac20	5320	Ant0	5350	-46.57	3.09	-	51.75	Peak	68.2	Pass
NVNT	ac20	5320	Ant0	5350	-56.99	3.09	0.12	41.45	Average	54	Pass
NVNT	ac20	5320	Ant0	5350.2	-44.86	3.09	-	53.46	Peak	68.2	Pass
NVNT	ac20	5320	Ant0	5351.8	-56.31	3.09	0.12	42.13	Average	54	Pass
NVNT	ac20	5320	Ant0	5460	-50.01	3.09	-	48.31	Peak	68.2	Pass
NVNT	ac20	5320	Ant0	5460	-57.86	3.09	0.12	40.58	Average	54	Pass
NVNT	ac40	5270	Ant0	4500	-49.99	3.09	-	48.33	Peak	68.2	Pass
NVNT	ac40	5270	Ant0	4500	-58.6	3.09	0.12	39.84	Average	54	Pass
NVNT	ac40	5270	Ant0	5139.9	-46.64	3.09	-	51.68	Peak	68.2	Pass
NVNT	ac40	5270	Ant0	4772.97	-56.22	3.09	0.12	42.22	Average	54	Pass
NVNT	ac40	5270	Ant0	5150	-49.35	3.09	-	48.97	Peak	68.2	Pass
NVNT	ac40	5270	Ant0	5150	-57.54	3.09	0.12	40.9	Average	54	Pass
NVNT	ac40	5310	Ant0	5350	-46.12	3.09	-	52.2	Peak	68.2	Pass
NVNT	ac40	5310	Ant0	5350	-56.94	3.09	0.12	41.5	Average	54	Pass
NVNT	ac40	5310	Ant0	5352.6	-43.49	3.09	-	54.83	Peak	68.2	Pass
NVNT	ac40	5310	Ant0	5350.2	-56.29	3.09	0.12	42.15	Average	54	Pass
NVNT	ac40	5310	Ant0	5460	-50.85	3.09	-	47.47	Peak	68.2	Pass
NVNT	ac40	5310	Ant0	5460	-57.88	3.09	0.12	40.56	Average	54	Pass
NVNT	ac80	5290	Ant0	4500	-50.02	3.09	-	48.3	Peak	68.2	Pass
NVNT	ac80	5290	Ant0	4500	-59.06	3.09	0.25	39.51	Average	54	Pass
NVNT	ac80	5290	Ant0	5041.14	-45.84	3.09	-	52.48	Peak	68.2	Pass
NVNT	ac80	5290	Ant0	5148.15	-56.31	3.09	0.25	42.26	Average	54	Pass
NVNT	ac80	5290	Ant0	5150	-47.23	3.09	-	51.09	Peak	68.2	Pass
NVNT	ac80	5290	Ant0	5150	-56.4	3.09	0.25	42.17	Average	54	Pass
NVNT	ac80	5290	Ant0	5350	-44.6	3.09	-	53.72	Peak	68.2	Pass
NVNT	ac80	5290	Ant0	5350	-54.63	3.09	0.25	43.94	Average	54	Pass
NVNT	ac80	5290	Ant0	5350.25	-39.88	3.09	-	58.44	Peak	68.2	Pass
NVNT	ac80	5290	Ant0	5352.5	-54.4	3.09	0.25	44.17	Average	54	Pass
NVNT	ac80	5290	Ant0	5460	-49.96	3.09	-	48.36	Peak	68.2	Pass
NVNT	ac80	5290	Ant0	5460	-57.52	3.09	0.25	41.05	Average	54	Pass
NVNT	ac160	5250	Ant0	5350	-49.65	3.09	-	48.67	Peak	68.2	Pass
NVNT	ac160	5250	Ant0	5350	-57.64	3.09	0.4	41.08	Average	54	Pass
NVNT	ac160	5250	Ant0	5354.18	-45	3.09	-	53.32	Peak	68.2	Pass
NVNT	ac160	5250	Ant0	5356.4	-54.99	3.09	0.4	43.73	Average	54	Pass
NVNT	ac160	5250	Ant0	5460	-56.16	3.09	-	42.16	Peak	68.2	Pass
NVNT	ac160	5250	Ant0	5460	-63.87	3.09	0.4	34.85	Average	54	Pass
NVNT	ac160	5250	Ant0	4500	-60.42	3.09	-	37.9	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant0	4500	-69.29	3.09	0.4	29.43	Average	54	Pass
NVNT	ac160	5250	Ant0	5145.19	-47.39	3.09	-	50.93	Peak	68.2	Pass
NVNT	ac160	5250	Ant0	4874.01	-54.08	3.09	0.4	44.64	Average	54	Pass
NVNT	ac160	5250	Ant0	5150	-51.51	3.09	-	46.81	Peak	68.2	Pass
NVNT	ac160	5250	Ant0	5150	-58.59	3.09	0.4	40.13	Average	54	Pass
NVNT	ax20	5260	Ant0	4500	-49.82	3.09	-	48.5	Peak	68.2	Pass
NVNT	ax20	5260	Ant0	4500	-59.1	3.09	0.12	39.34	Average	54	Pass
NVNT	ax20	5260	Ant0	4773	-46.96	3.09	-	51.36	Peak	68.2	Pass
NVNT	ax20	5260	Ant0	4787.82	-55.73	3.09	0.12	42.71	Average	54	Pass
NVNT	ax20	5260	Ant0	5150	-47.86	3.09	-	50.46	Peak	68.2	Pass
NVNT	ax20	5260	Ant0	5150	-56.52	3.09	0.12	41.92	Average	54	Pass
NVNT	ax20	5320	Ant0	5350	-43.21	3.09	-	55.11	Peak	68.2	Pass
NVNT	ax20	5320	Ant0	5350	-55.06	3.09	0.12	43.38	Average	54	Pass
NVNT	ax20	5320	Ant0	5354.2	-40.08	3.09	-	58.24	Peak	68.2	Pass
NVNT	ax20	5320	Ant0	5350	-55.06	3.09	0.12	43.38	Average	54	Pass
NVNT	ax20	5320	Ant0	5460	-50.67	3.09	-	47.65	Peak	68.2	Pass
NVNT	ax20	5320	Ant0	5460	-57.99	3.09	0.12	40.45	Average	54	Pass
NVNT	ax40	5270	Ant0	4500	-50.22	3.09	-	48.1	Peak	68.2	Pass
NVNT	ax40	5270	Ant0	4500	-59	3.09	0.12	39.44	Average	54	Pass
NVNT	ax40	5270	Ant0	4772.97	-46.33	3.09	-	51.99	Peak	68.2	Pass
NVNT	ax40	5270	Ant0	5095.35	-56.78	3.09	0.12	41.66	Average	54	Pass
NVNT	ax40	5270	Ant0	5150	-49.57	3.09	-	48.75	Peak	68.2	Pass
NVNT	ax40	5270	Ant0	5150	-57.94	3.09	0.12	40.5	Average	54	Pass
NVNT	ax40	5310	Ant0	5350	-47.19	3.09	-	51.13	Peak	68.2	Pass
NVNT	ax40	5310	Ant0	5350	-54.17	3.09	0.12	44.27	Average	54	Pass
NVNT	ax40	5310	Ant0	5351.2	-42.01	3.09	-	56.31	Peak	68.2	Pass
NVNT	ax40	5310	Ant0	5350.2	-53.91	3.09	0.12	44.53	Average	54	Pass
NVNT	ax40	5310	Ant0	5460	-48.96	3.09	-	49.36	Peak	68.2	Pass
NVNT	ax40	5310	Ant0	5460	-57.97	3.09	0.12	40.47	Average	54	Pass
NVNT	ax80	5290	Ant0	5350	-45.6	3.09	-	52.72	Peak	68.2	Pass
NVNT	ax80	5290	Ant0	5350	-54.23	3.09	0.25	44.34	Average	54	Pass
NVNT	ax80	5290	Ant0	5350.5	-40.95	3.09	-	57.37	Peak	68.2	Pass
NVNT	ax80	5290	Ant0	5350	-54.23	3.09	0.25	44.34	Average	54	Pass
NVNT	ax80	5290	Ant0	5460	-47.79	3.09	-	50.53	Peak	68.2	Pass
NVNT	ax80	5290	Ant0	5460	-57.72	3.09	0.25	40.85	Average	54	Pass
NVNT	ax80	5290	Ant0	4500	-51.07	3.09	-	47.25	Peak	68.2	Pass
NVNT	ax80	5290	Ant0	4500	-59.49	3.09	0.25	39.08	Average	54	Pass
NVNT	ax80	5290	Ant0	5102.04	-45.71	3.09	-	52.61	Peak	68.2	Pass
NVNT	ax80	5290	Ant0	5148.15	-56.23	3.09	0.25	42.34	Average	54	Pass
NVNT	ax80	5290	Ant0	5150	-48.7	3.09	-	49.62	Peak	68.2	Pass
NVNT	ax80	5290	Ant0	5150	-56.55	3.09	0.25	42.02	Average	54	Pass
NVNT	ax160	5250	Ant0	5350	-47.92	3.09	-	50.4	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax160	5250	Ant0	5350	-57.82	3.09	0.5	41	Average	54	Pass
NVNT	ax160	5250	Ant0	5354.92	-47.63	3.09	-	50.69	Peak	68.2	Pass
NVNT	ax160	5250	Ant0	5356.03	-55.82	3.09	0.5	43	Average	54	Pass
NVNT	ax160	5250	Ant0	5460	-54.37	3.09	-	43.95	Peak	68.2	Pass
NVNT	ax160	5250	Ant0	5460	-63.45	3.09	0.5	35.37	Average	54	Pass
NVNT	ax160	5250	Ant0	4500	-60.28	3.09	-	38.04	Peak	68.2	Pass
NVNT	ax160	5250	Ant0	4500	-68.93	3.09	0.5	29.89	Average	54	Pass
NVNT	ax160	5250	Ant0	5145.19	-46.42	3.09	-	51.9	Peak	68.2	Pass
NVNT	ax160	5250	Ant0	4874.01	-55.63	3.09	0.5	43.19	Average	54	Pass
NVNT	ax160	5250	Ant0	5150	-49.5	3.09	-	48.82	Peak	68.2	Pass
NVNT	ax160	5250	Ant0	5150	-57.64	3.09	0.5	41.18	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5260MHz Ant0 Peak

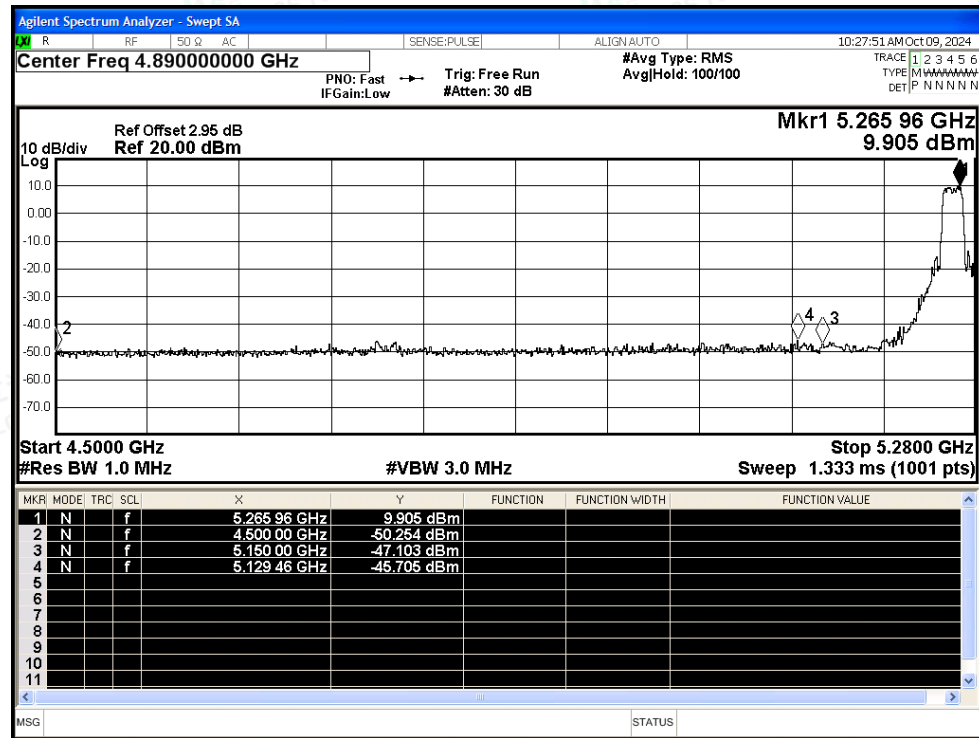

Restrict Band NVNT a 5260MHz Ant0 Average

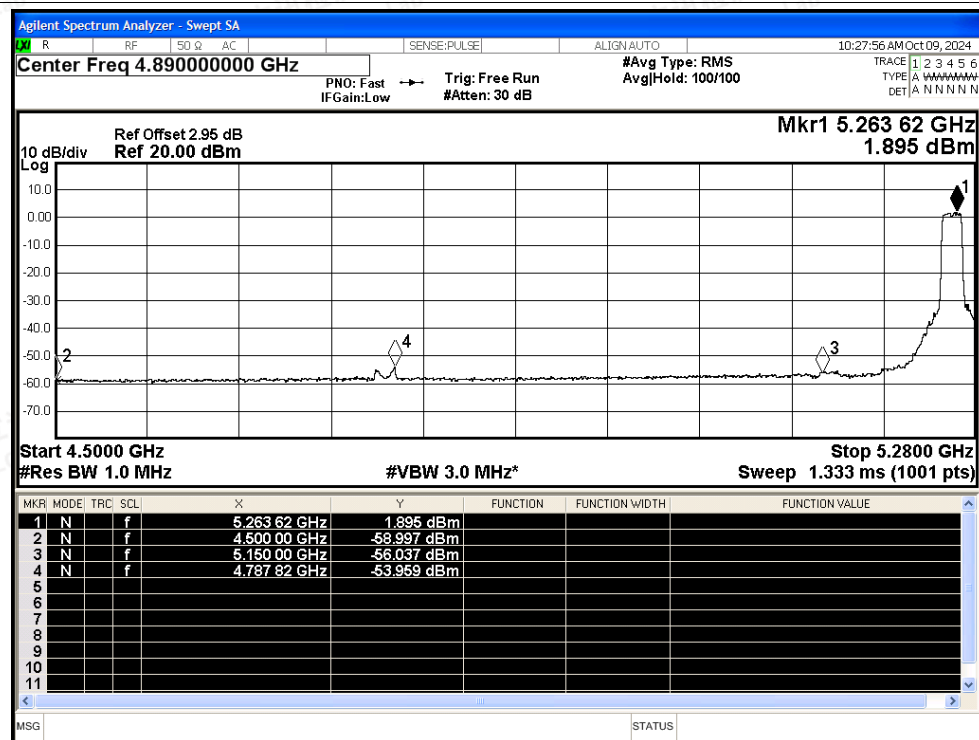

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant0 Peak

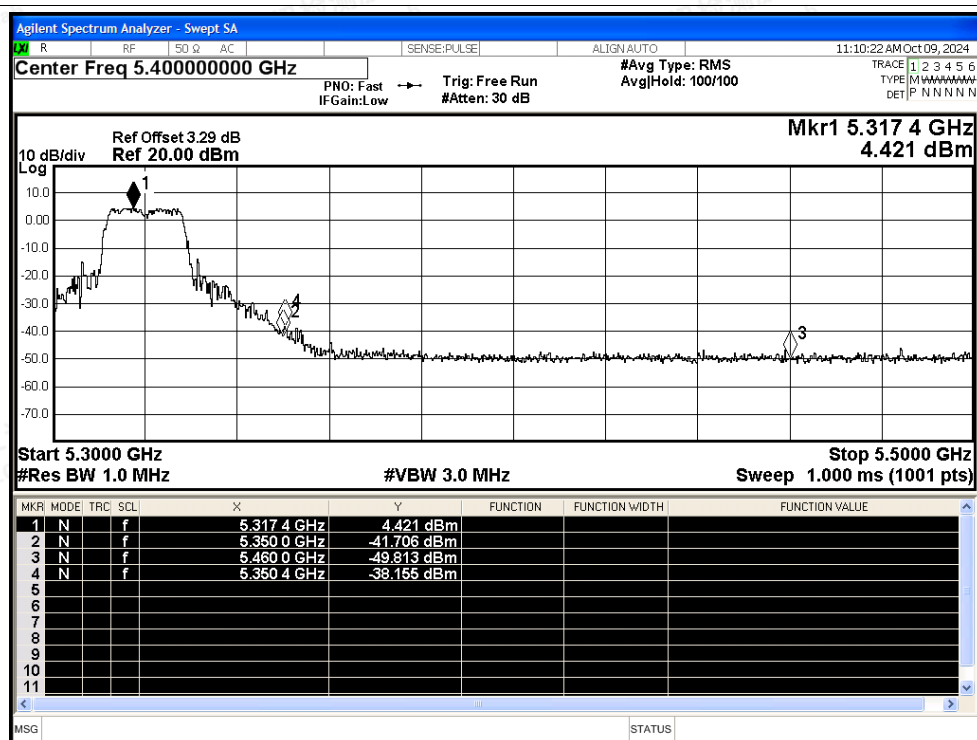

Restrict Band NVNT a 5320MHz Ant0 Average

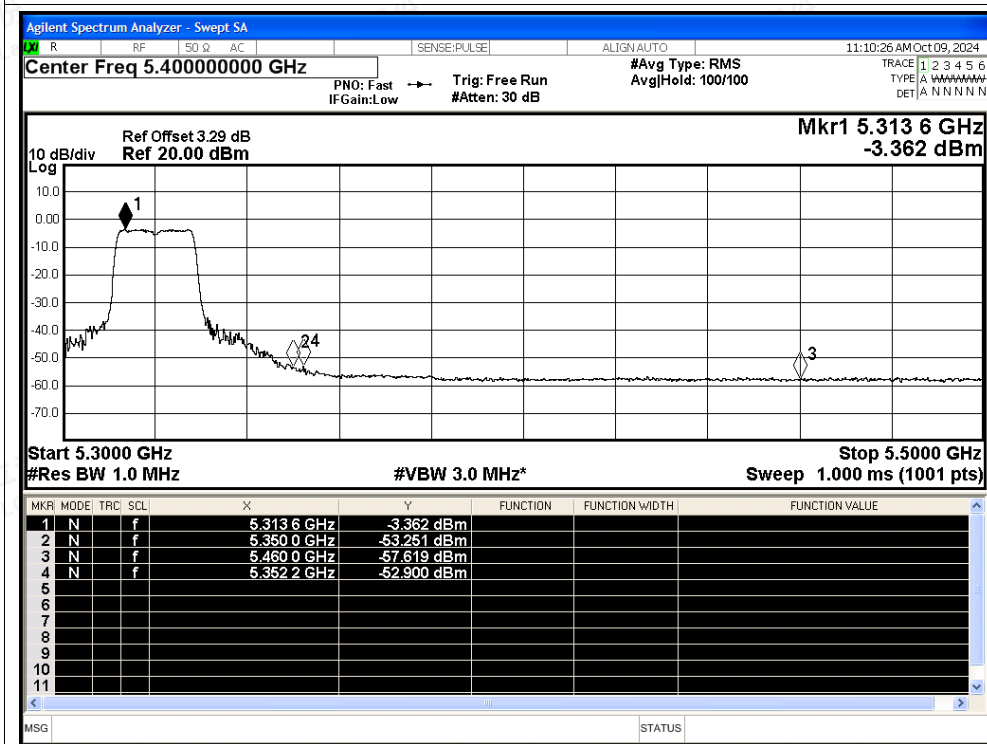

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5260MHz Ant0 Peak

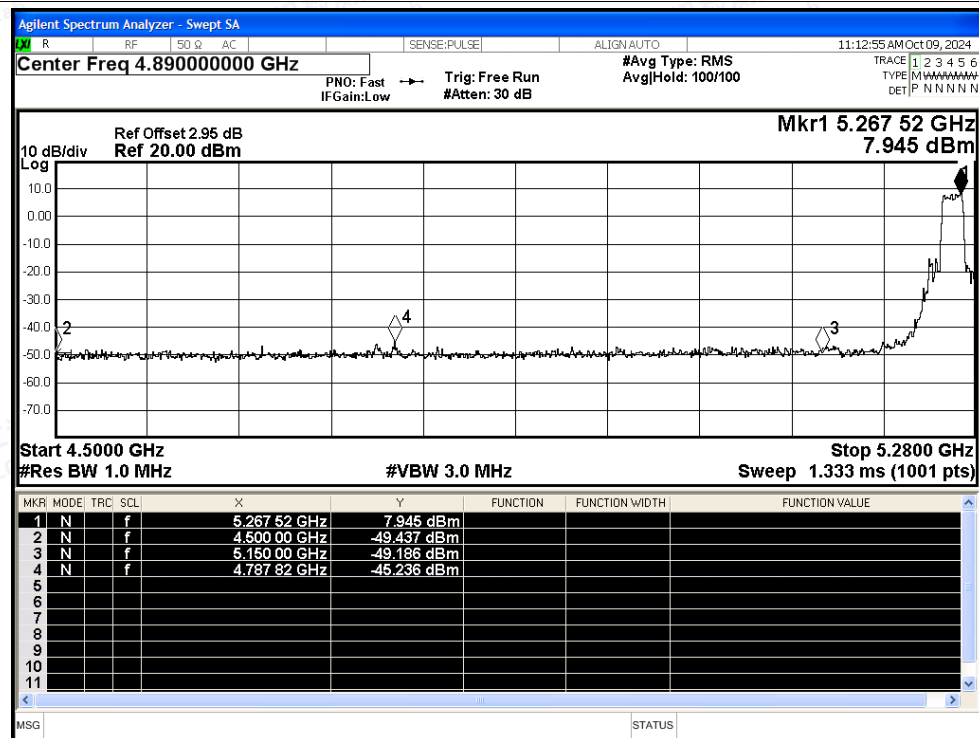

Restrict Band NVNT n20 5260MHz Ant0 Average

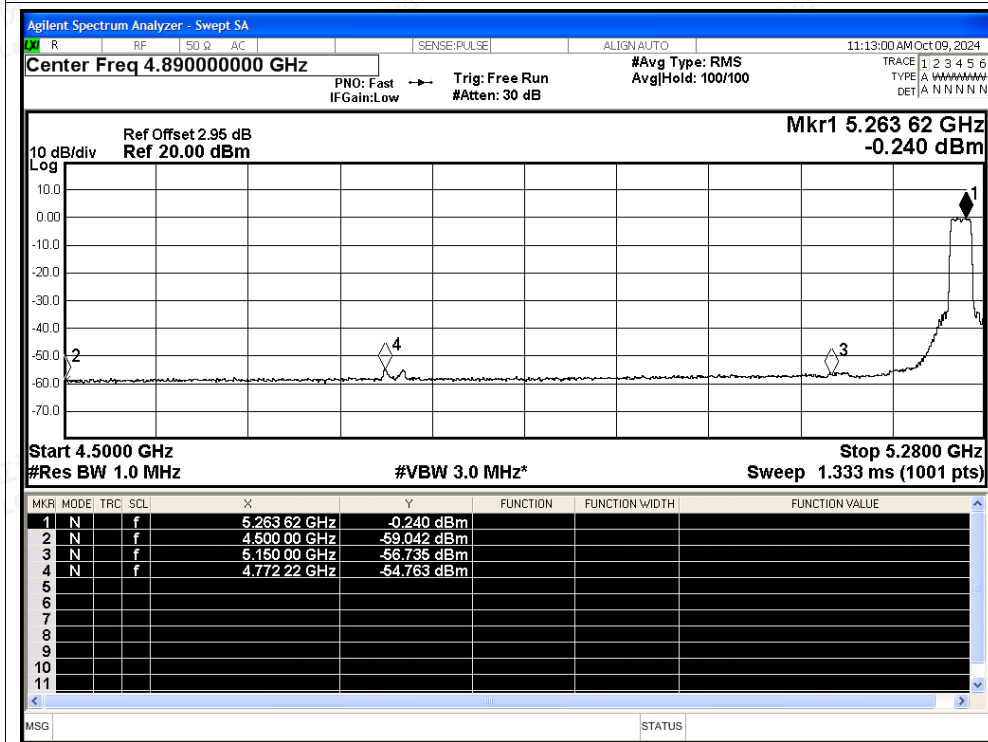

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n20 5320MHz Ant0 Peak

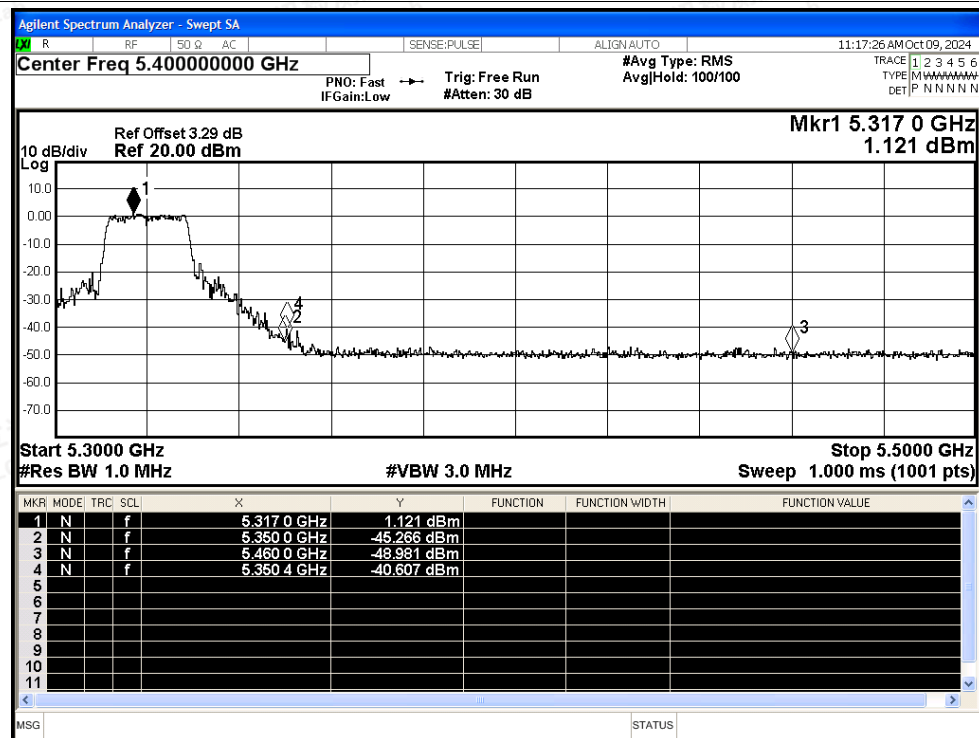


Restrict Band NVNT n20 5320MHz Ant0 Average

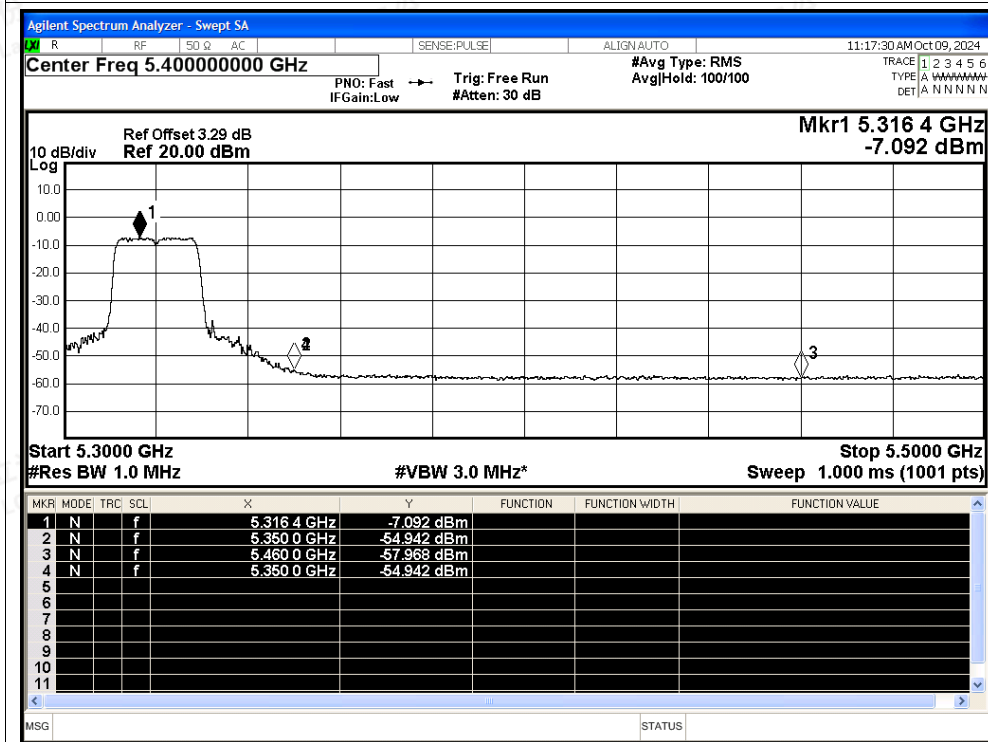




Restrict Band NVNT n40 5270MHz Ant0 Peak

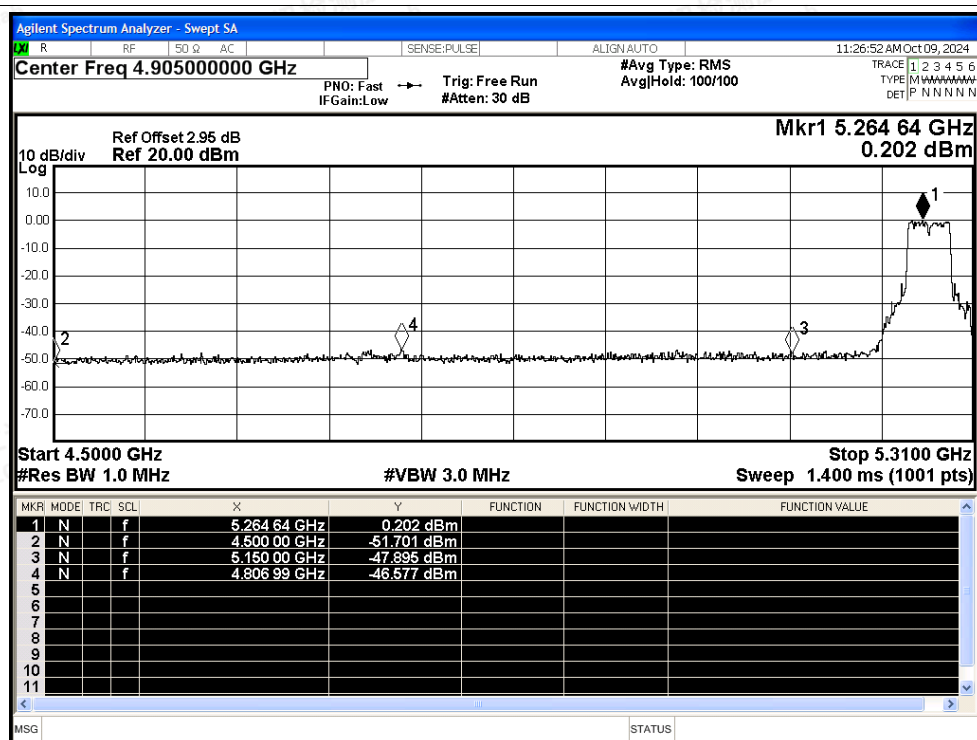

Restrict Band NVNT n40 5270MHz Ant0 Average

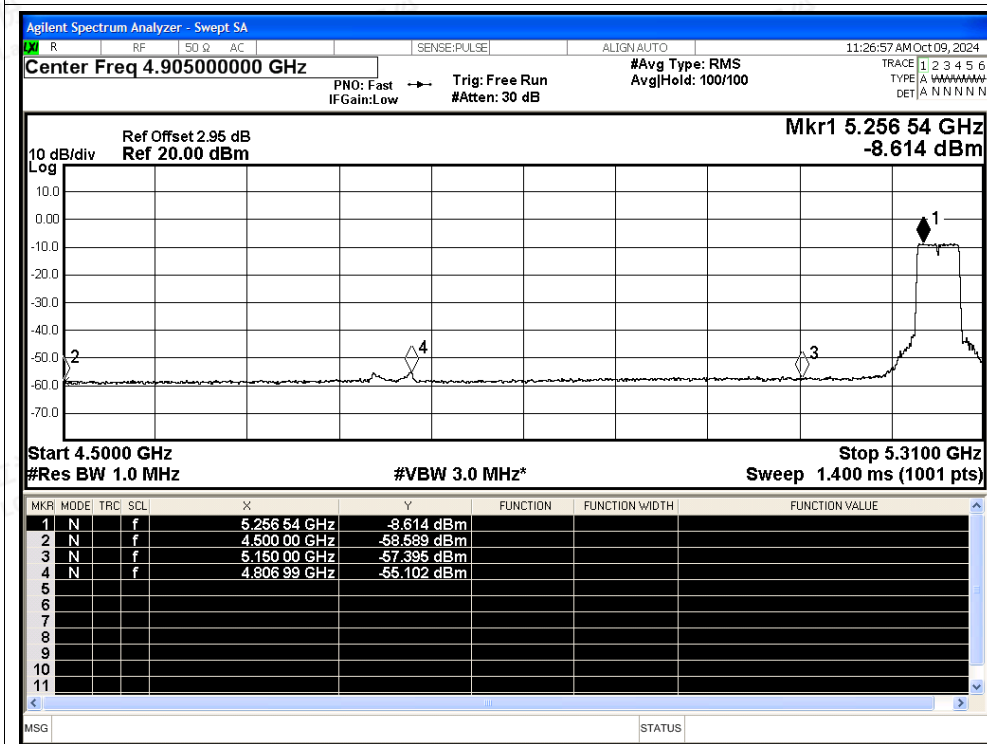

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant0 Peak

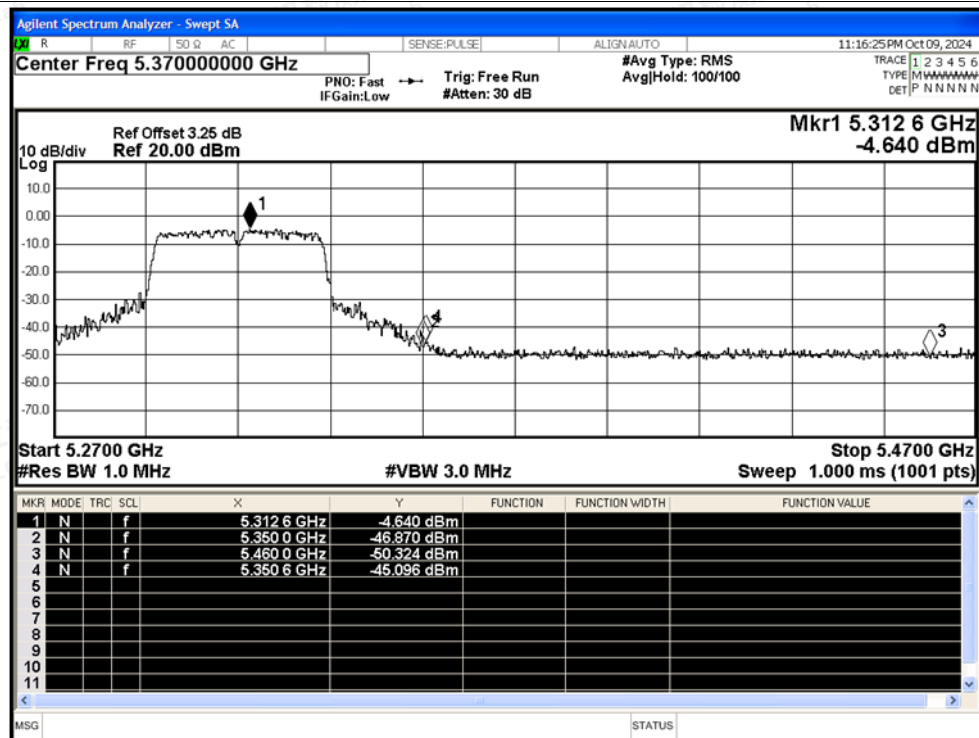


Restrict Band NVNT n40 5310MHz Ant0 Average

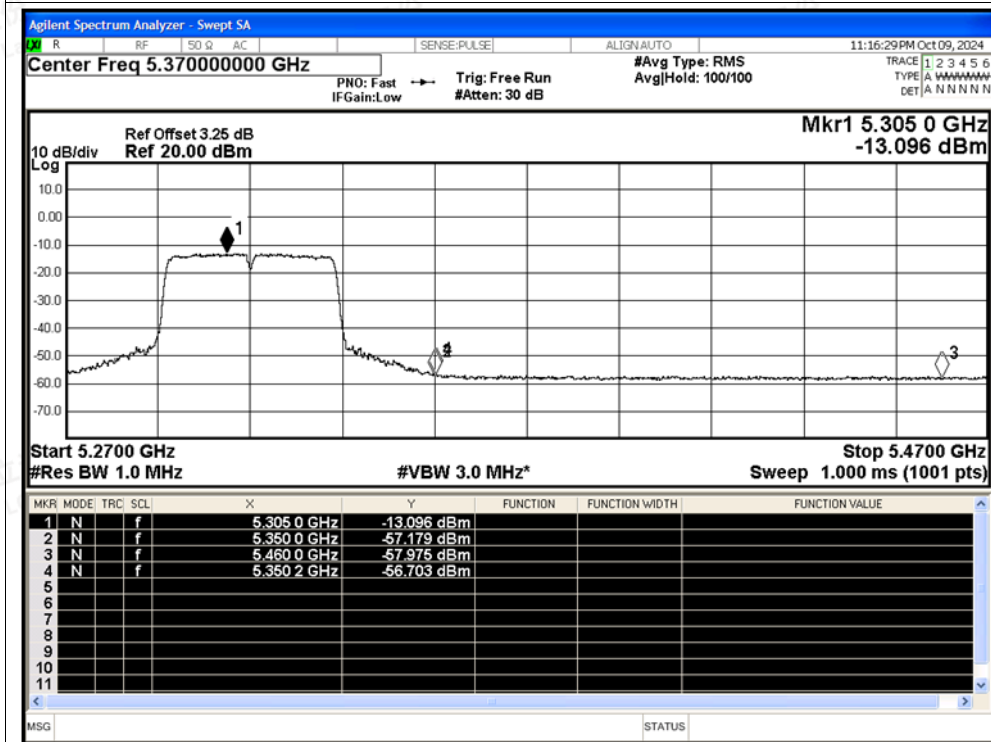




Restrict Band NVNT ac20 5260MHz Ant0 Peak

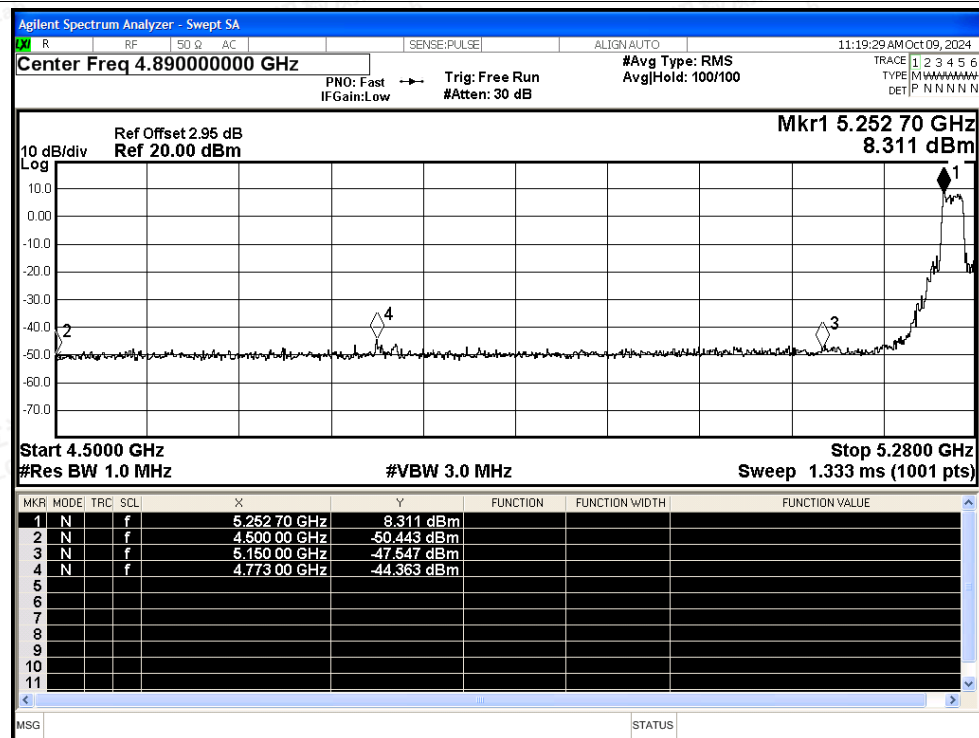

Restrict Band NVNT ac20 5260MHz Ant0 Average

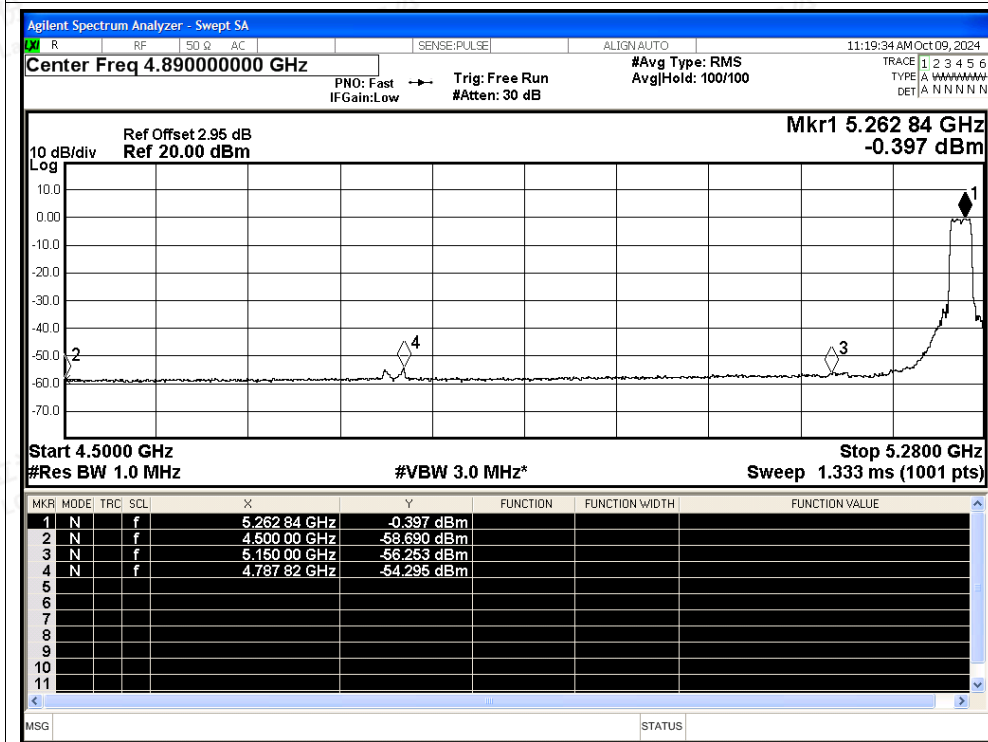

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5320MHz Ant0 Peak

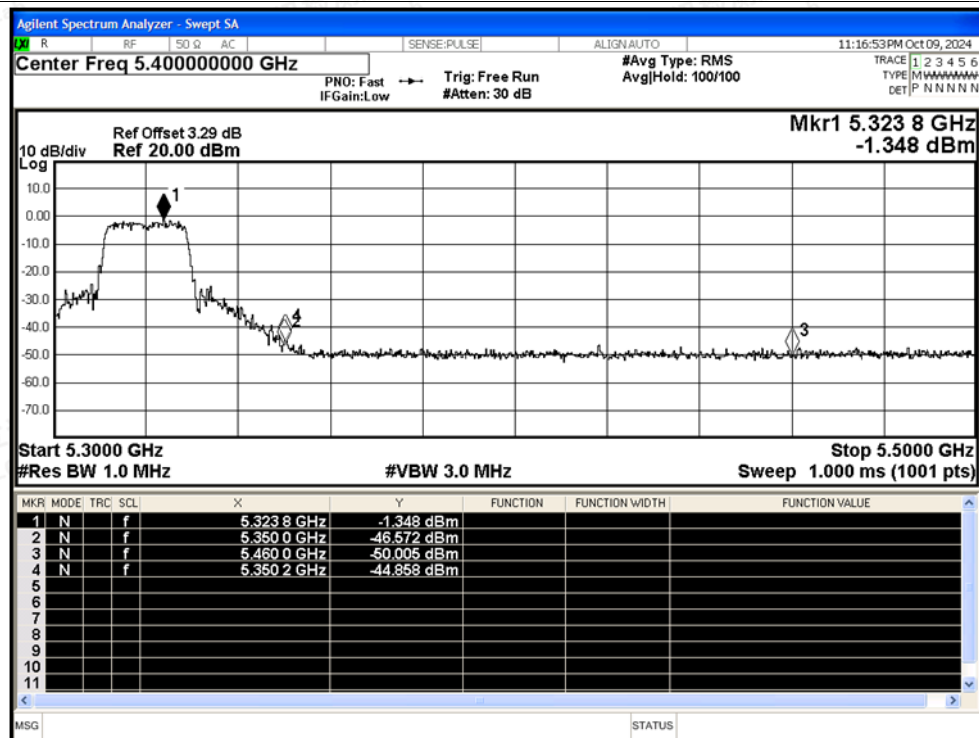


Restrict Band NVNT ac20 5320MHz Ant0 Average

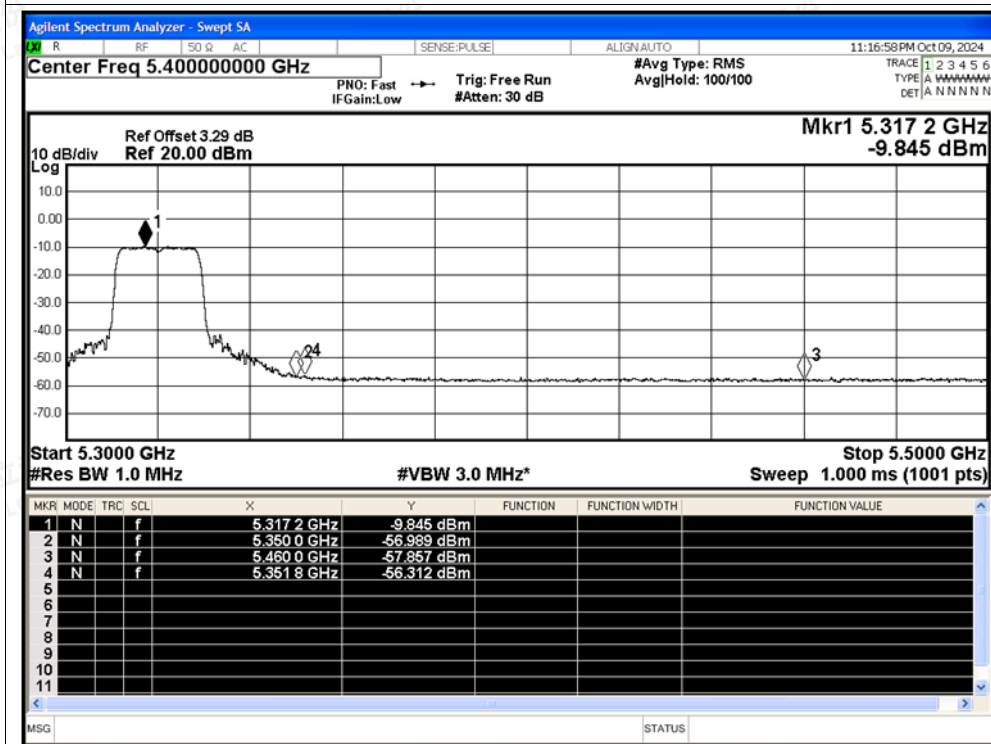




Restrict Band NVNT ac40 5270MHz Ant0 Peak

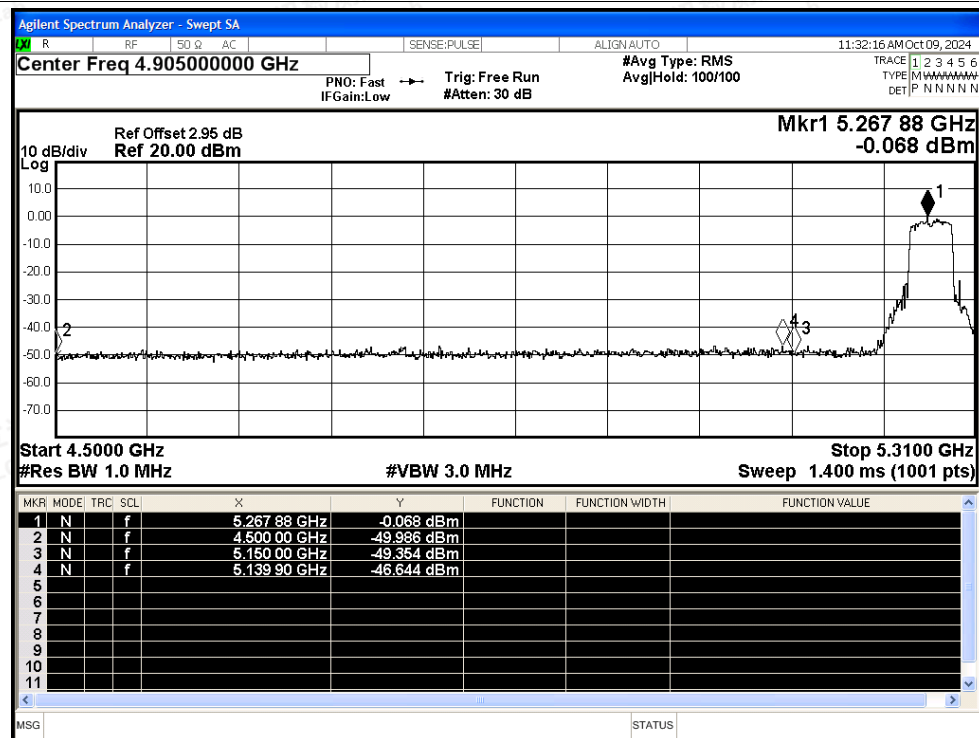

Restrict Band NVNT ac40 5270MHz Ant0 Average

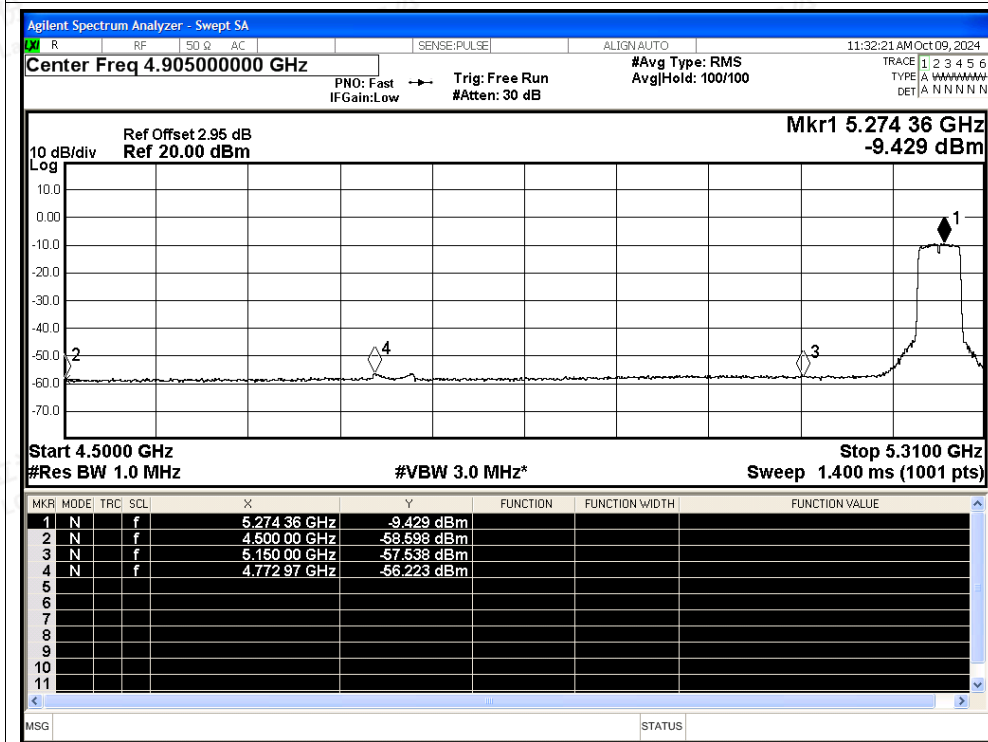

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5310MHz Ant0 Peak

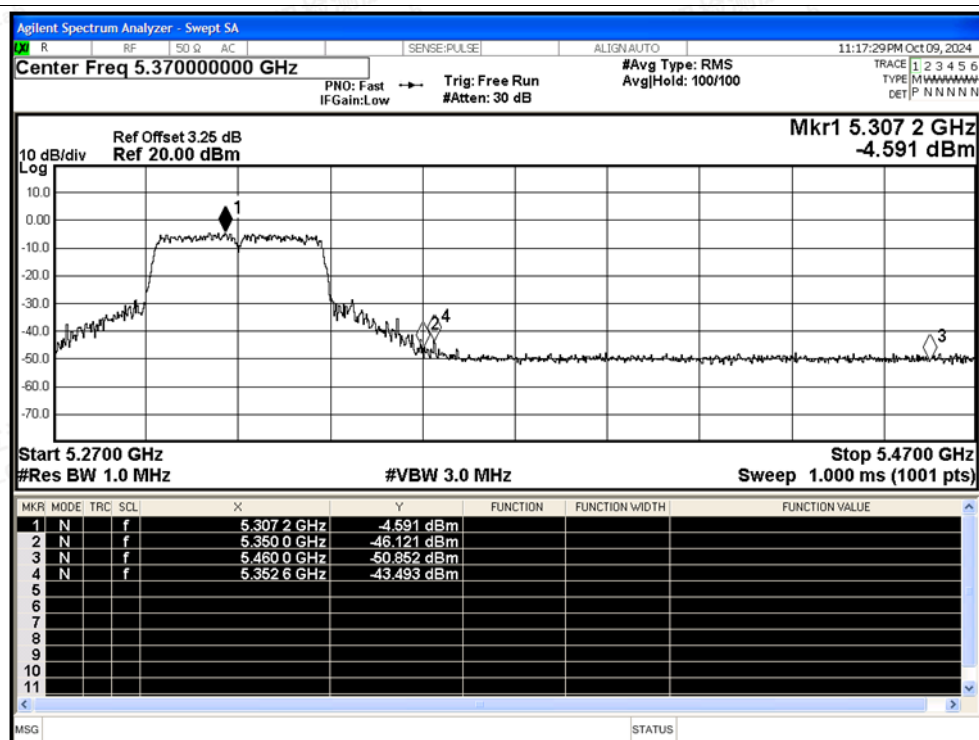

Restrict Band NVNT ac40 5310MHz Ant0 Average

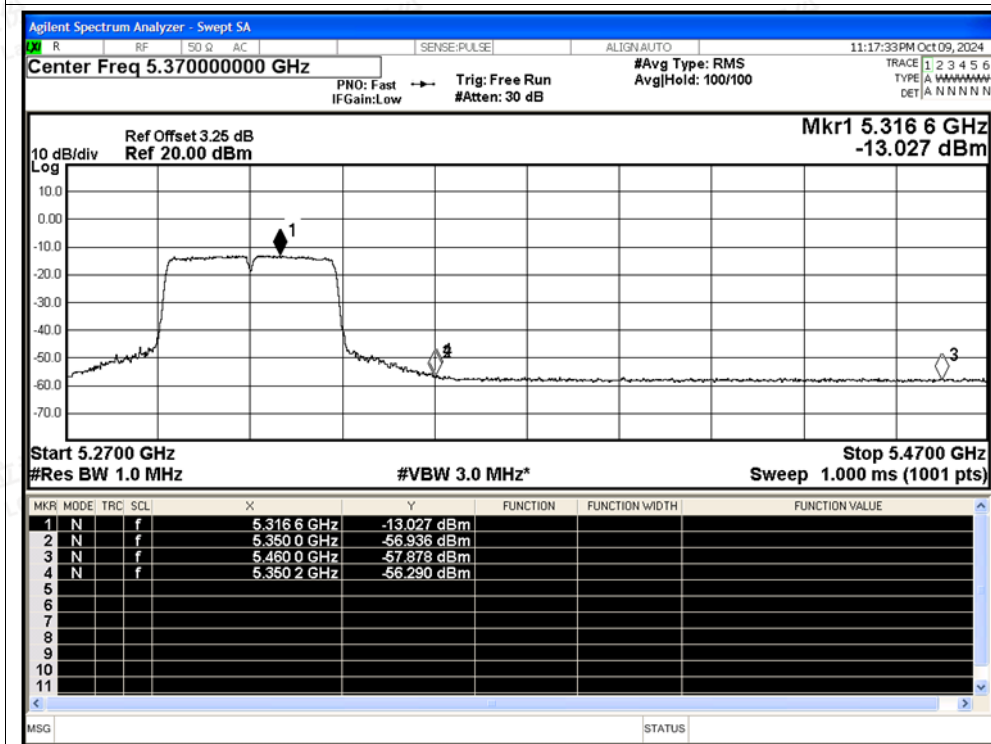

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant0 Peak

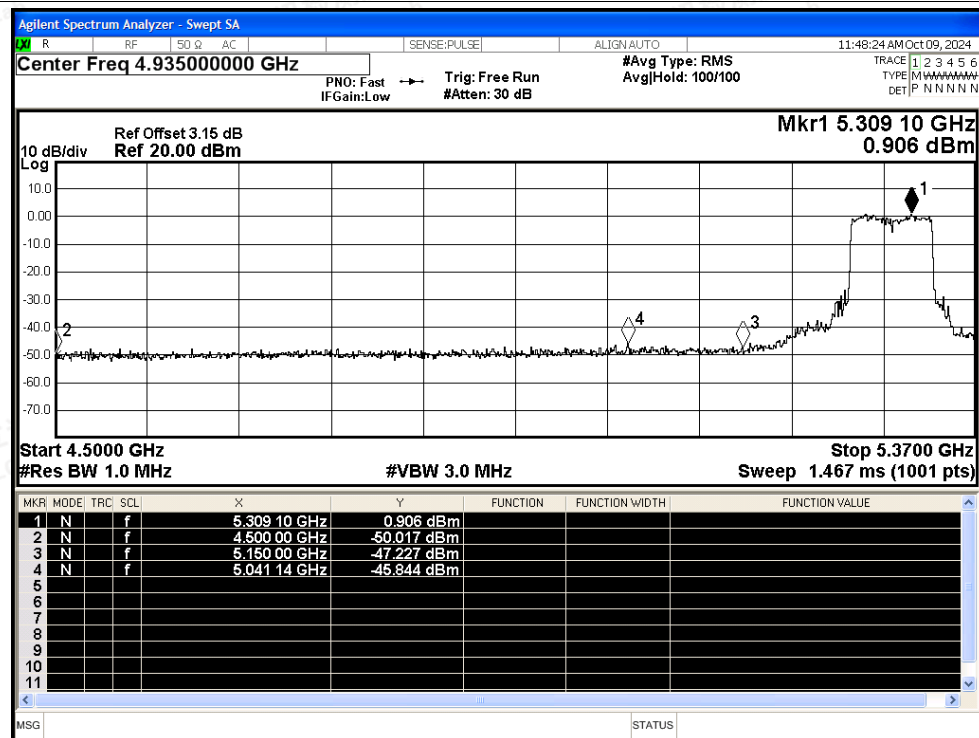

Restrict Band NVNT ac80 5290MHz Ant0 Average

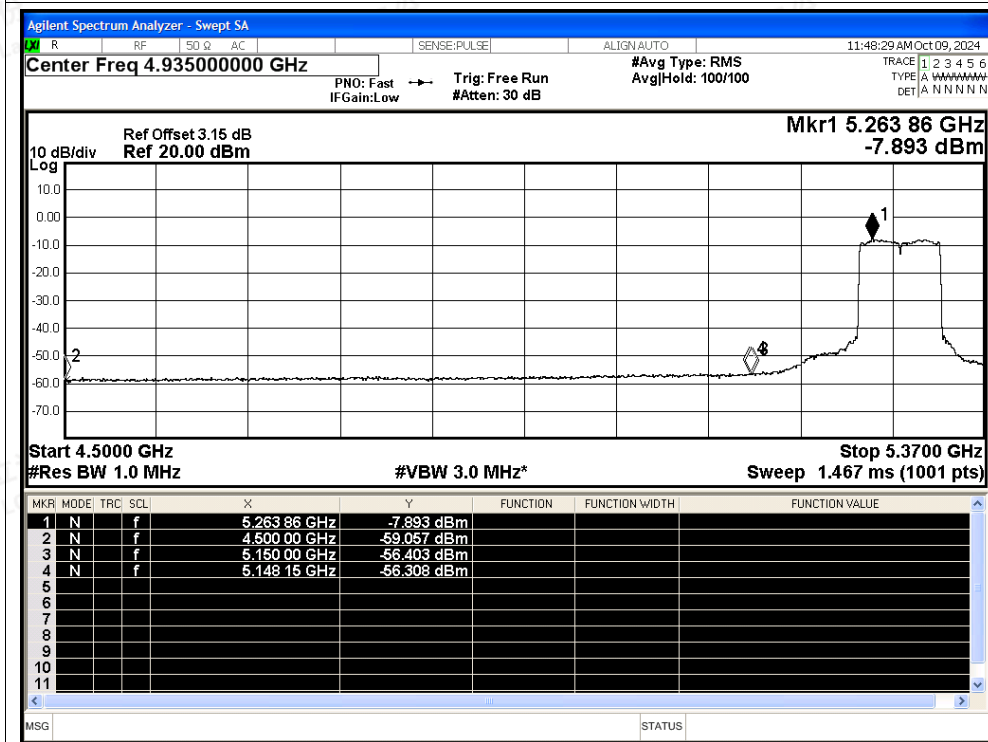

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant0 Peak

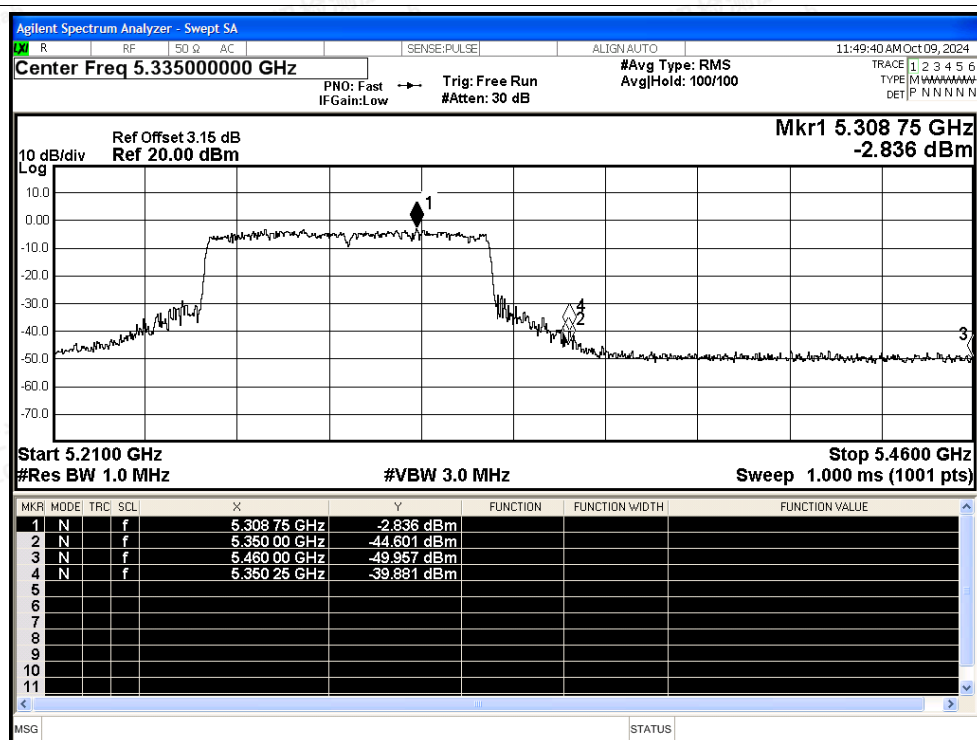

Restrict Band NVNT ac80 5290MHz Ant0 Average

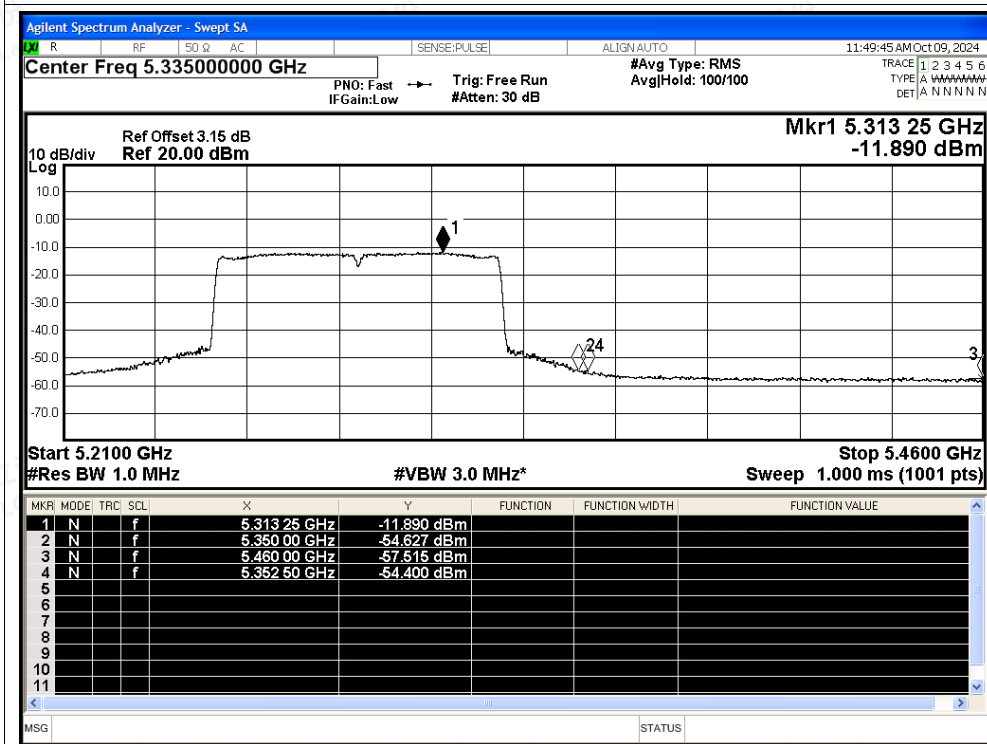

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Test Graphs

Restrict Band NVNT ac160 5250MHz Ant0 Peak

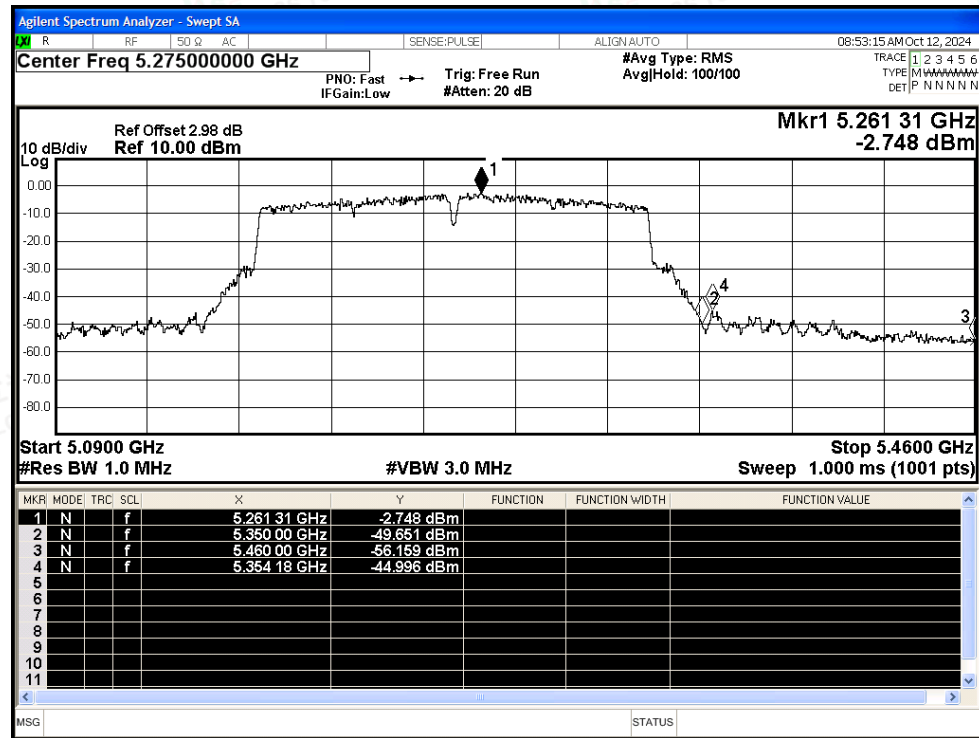

Restrict Band NVNT ac160 5250MHz Ant0 Average

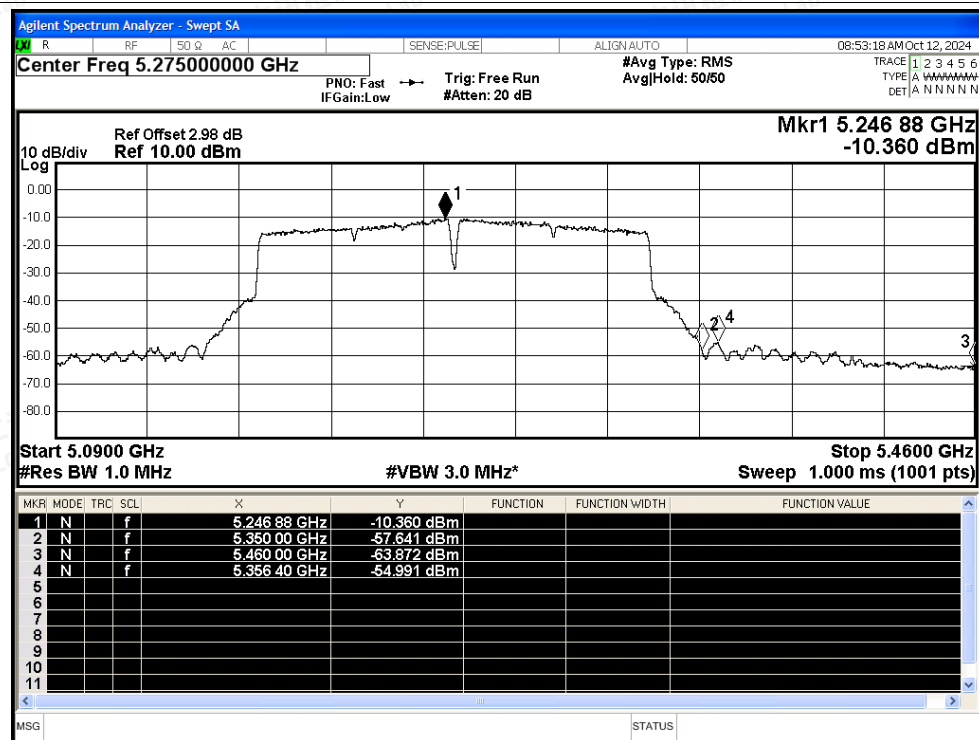

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant0 Peak

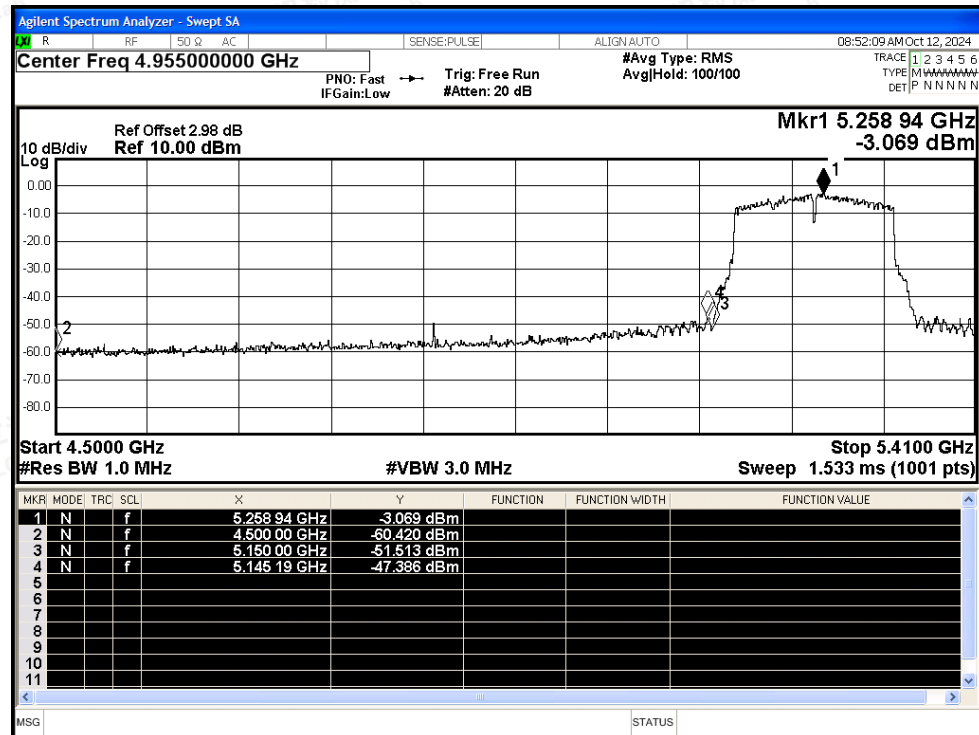

Restrict Band NVNT ac160 5250MHz Ant0 Average


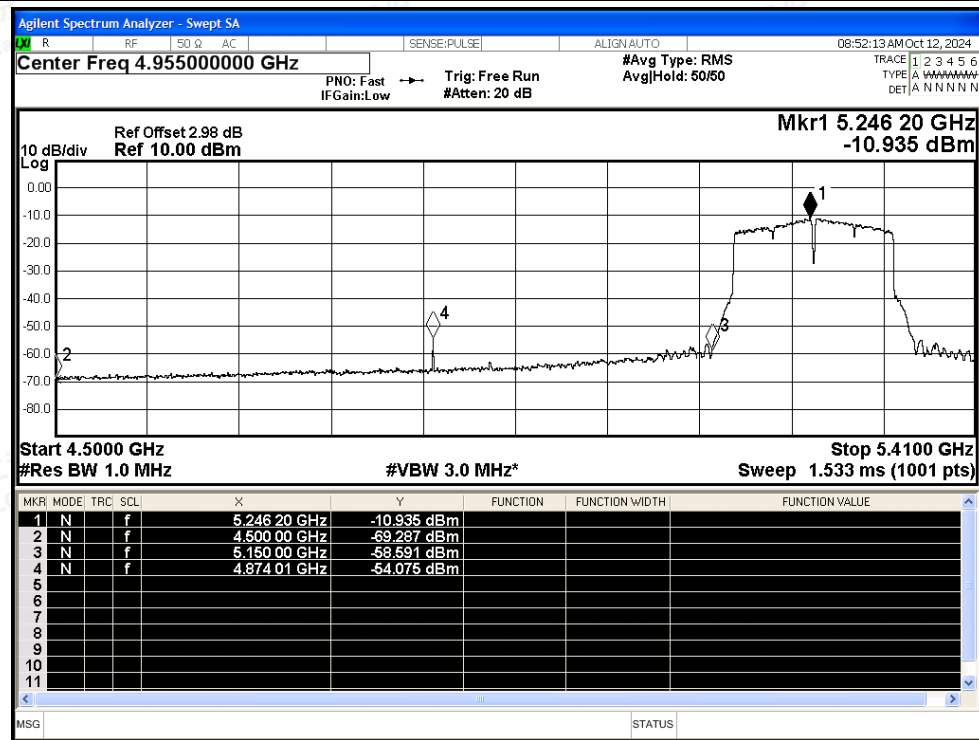


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

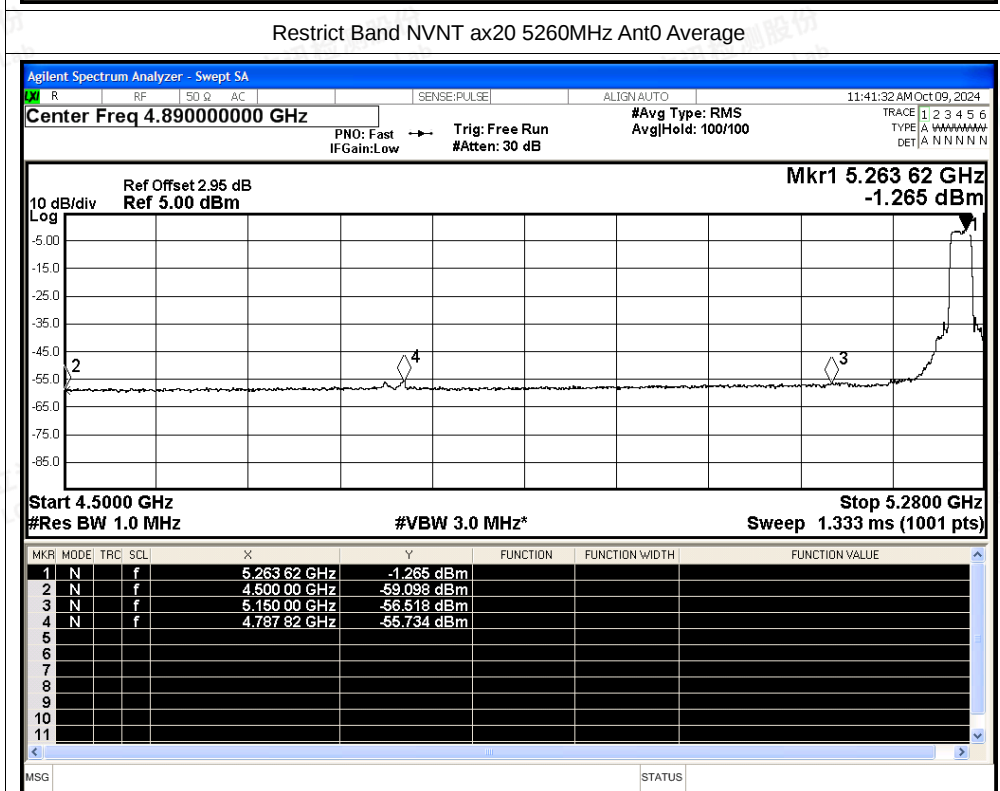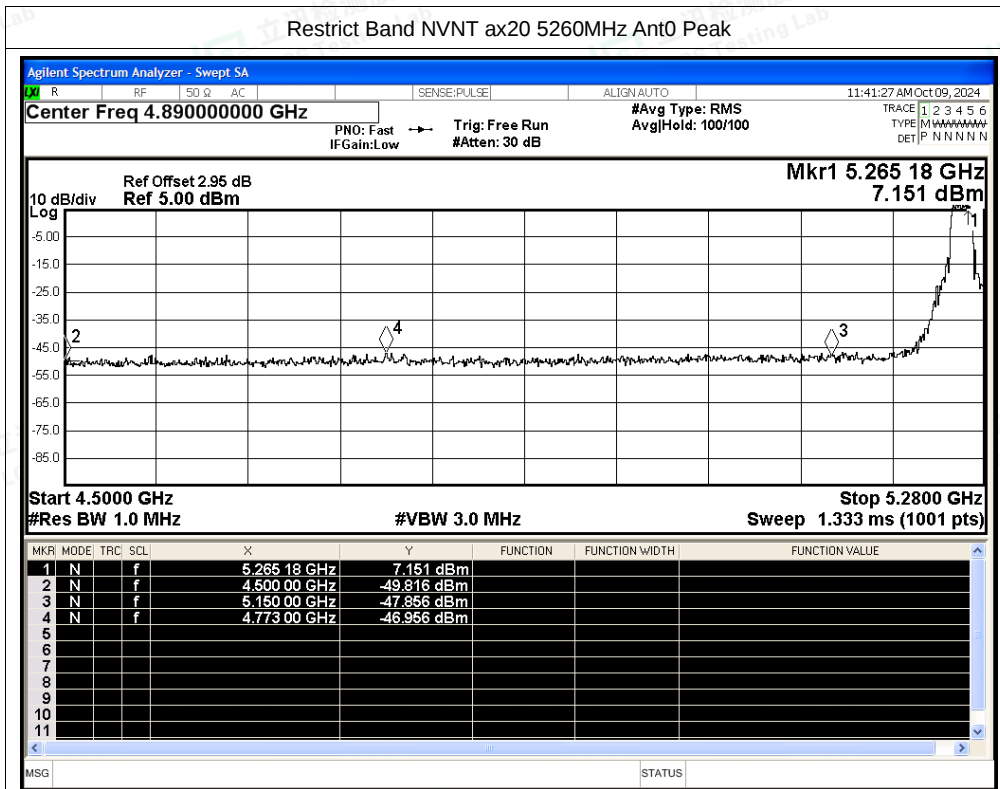




Restrict Band NVNT ax20 5320MHz Ant0 Peak

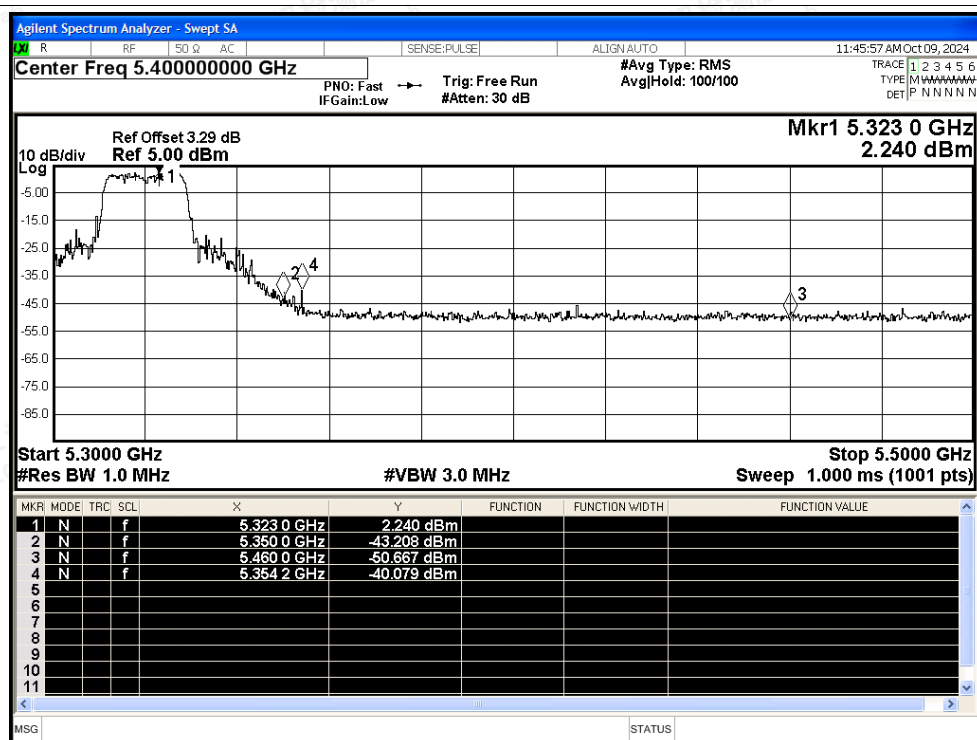

Restrict Band NVNT ax20 5320MHz Ant0 Average

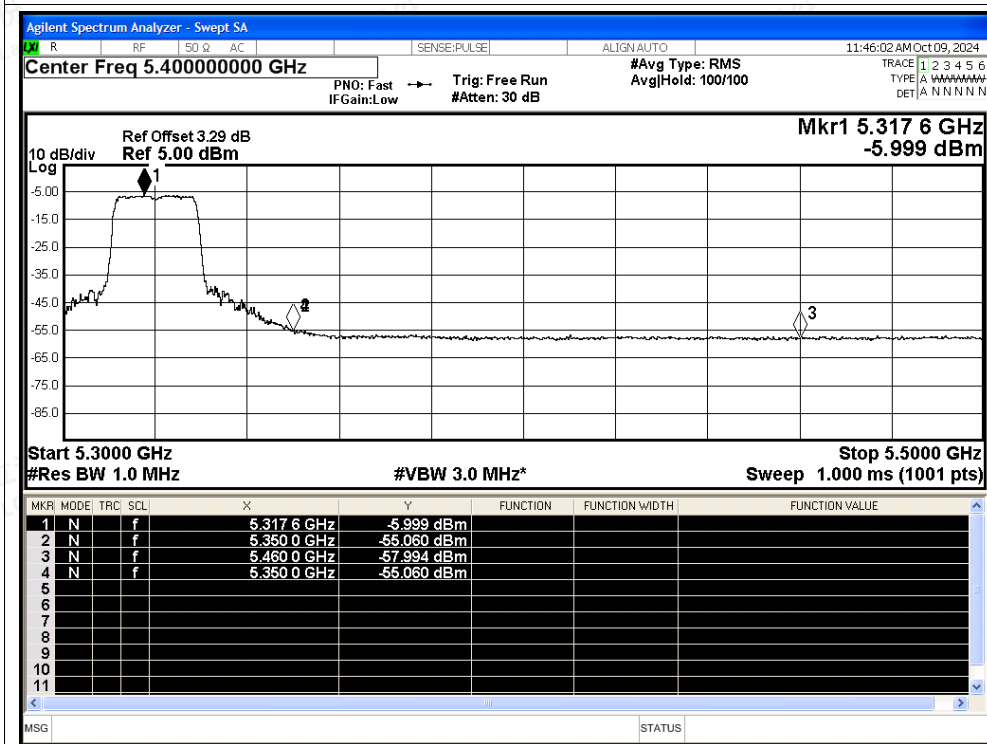

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5270MHz Ant0 Peak

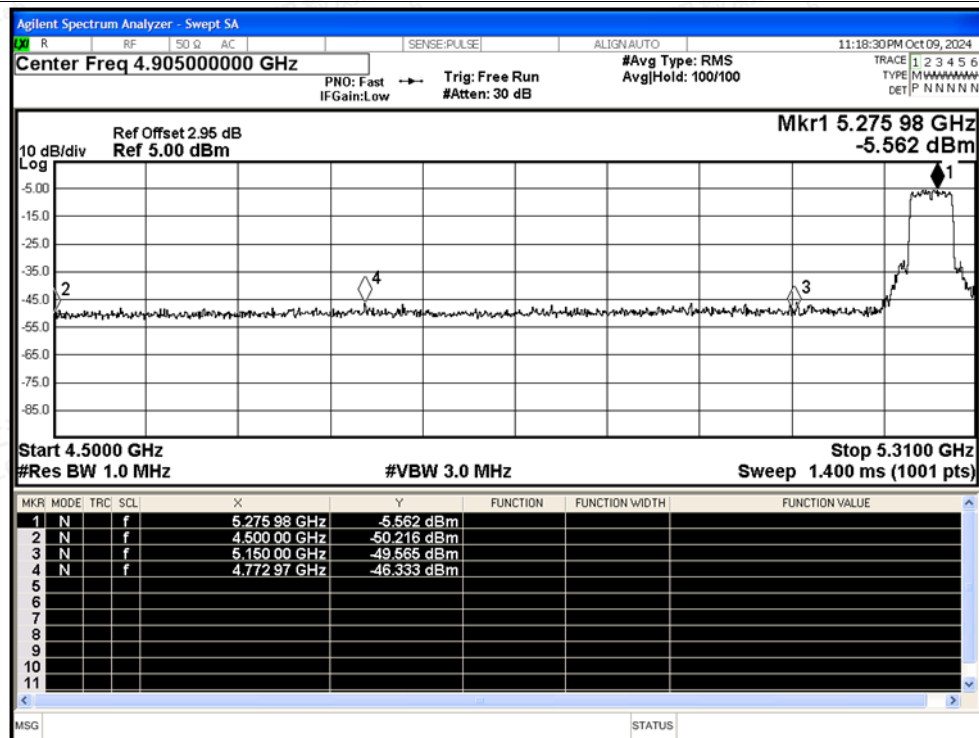


Restrict Band NVNT ax40 5270MHz Ant0 Average

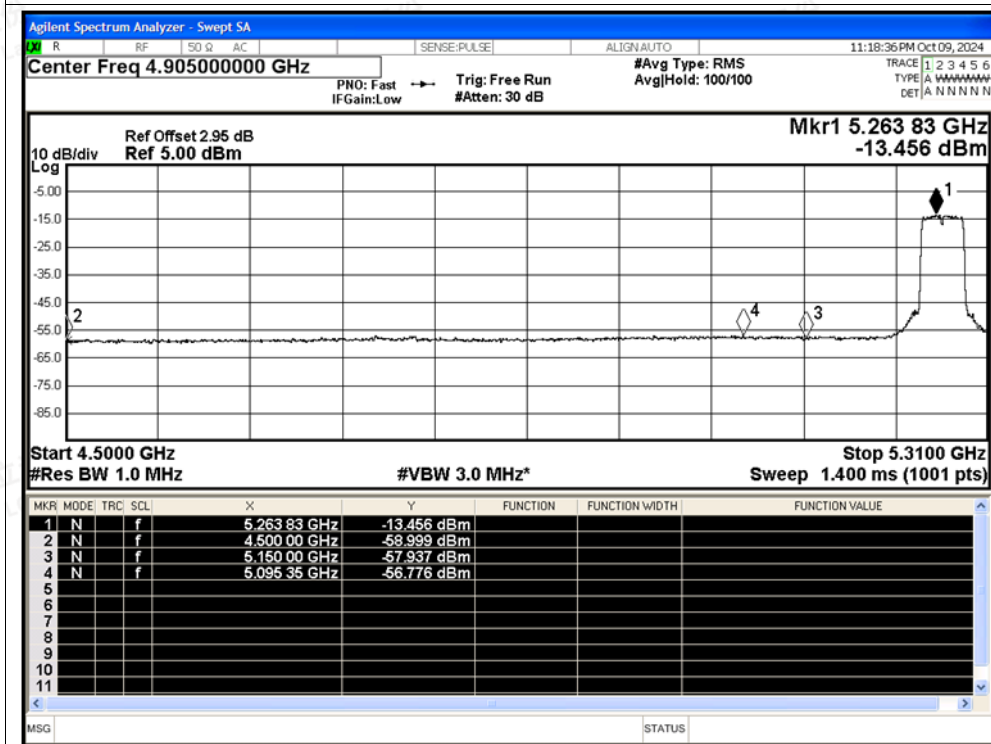




Restrict Band NVNT ax40 5310MHz Ant0 Peak

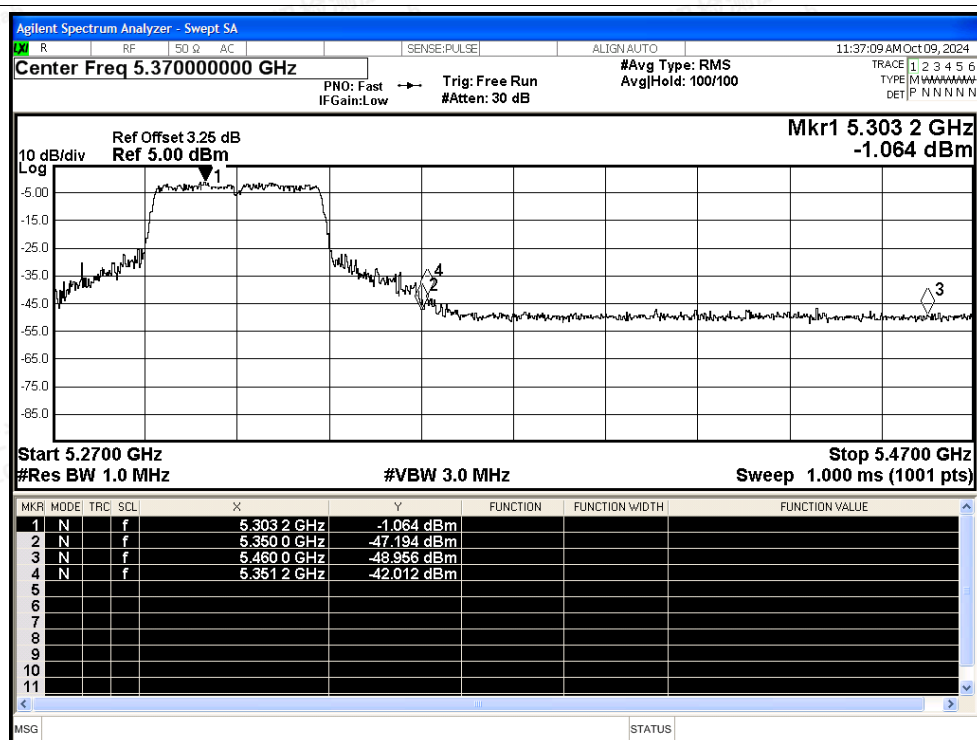

Restrict Band NVNT ax40 5310MHz Ant0 Average

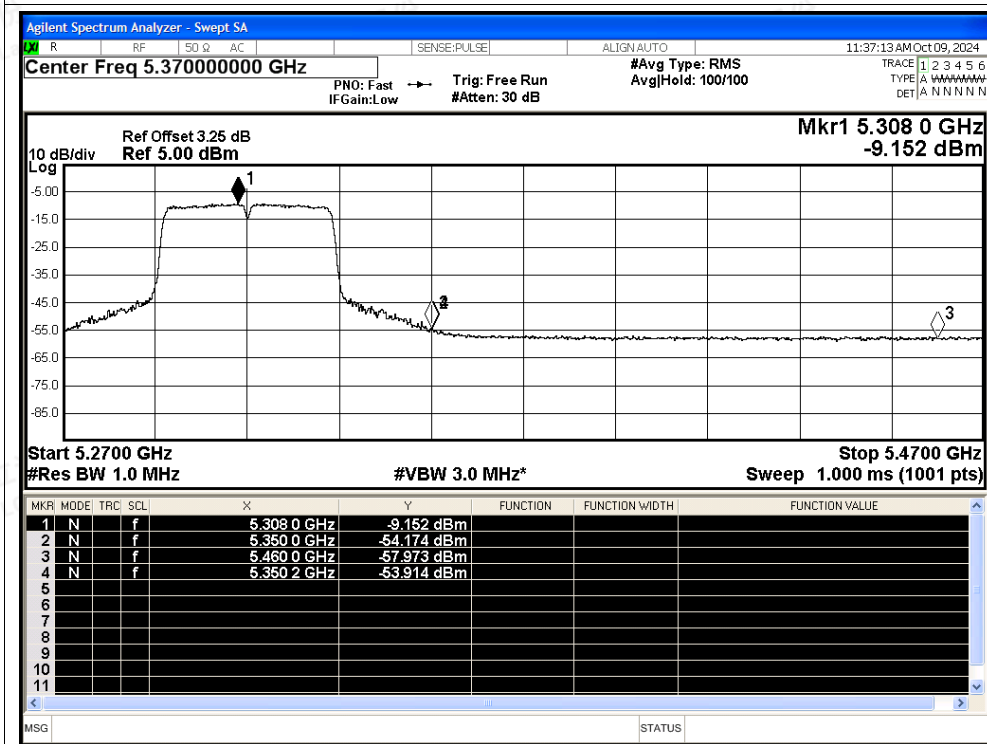

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant0 Peak

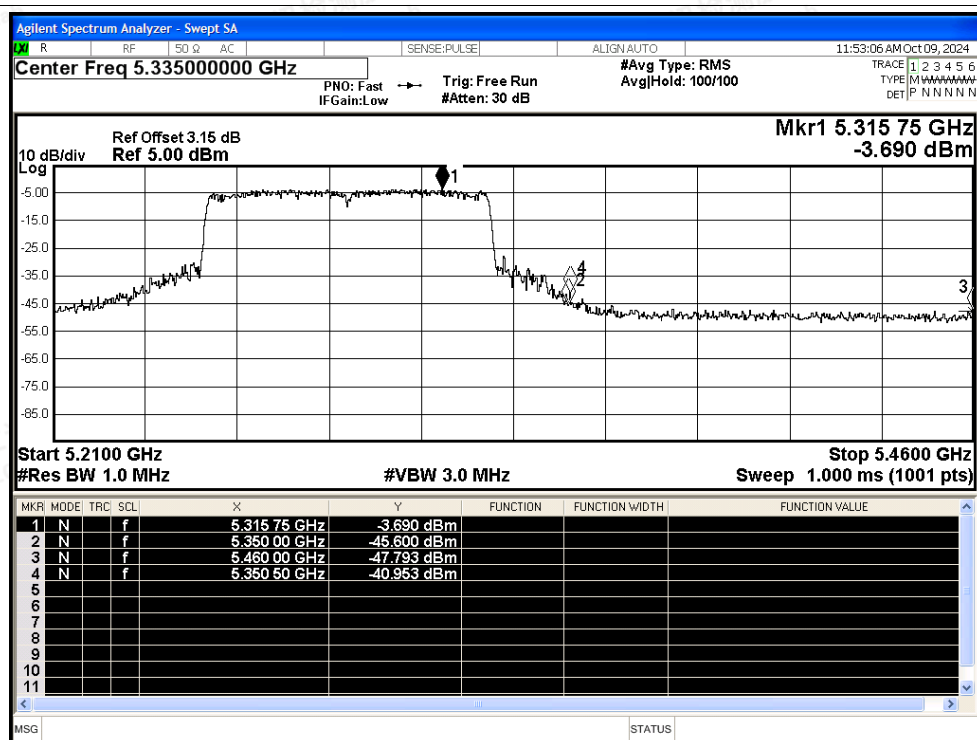

Restrict Band NVNT ax80 5290MHz Ant0 Average

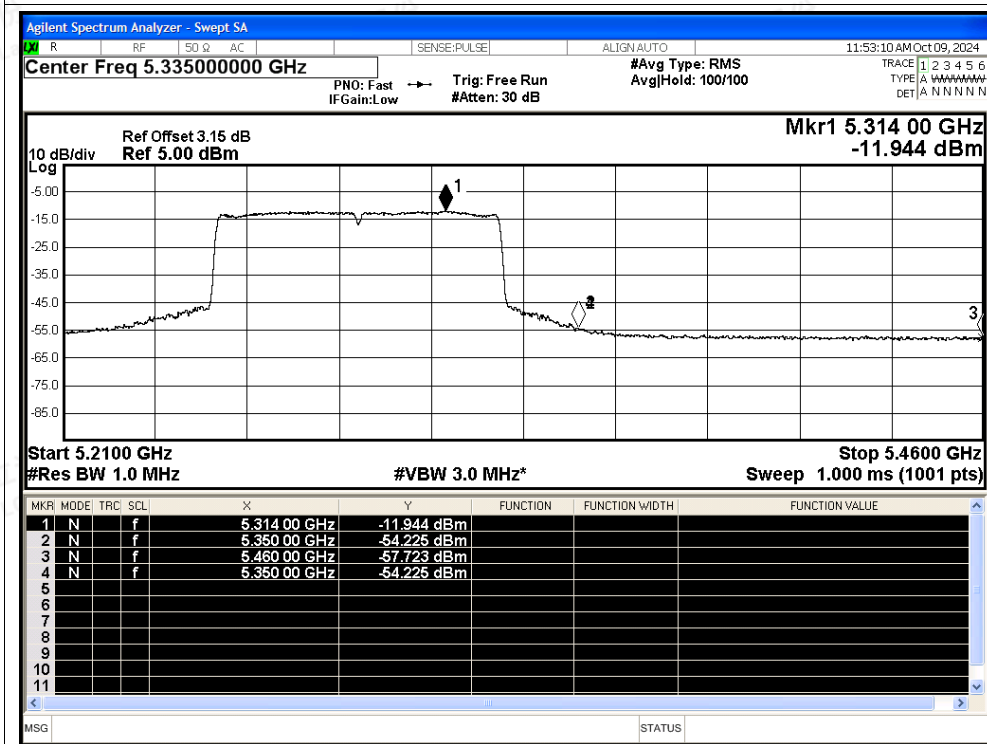

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant0 Peak

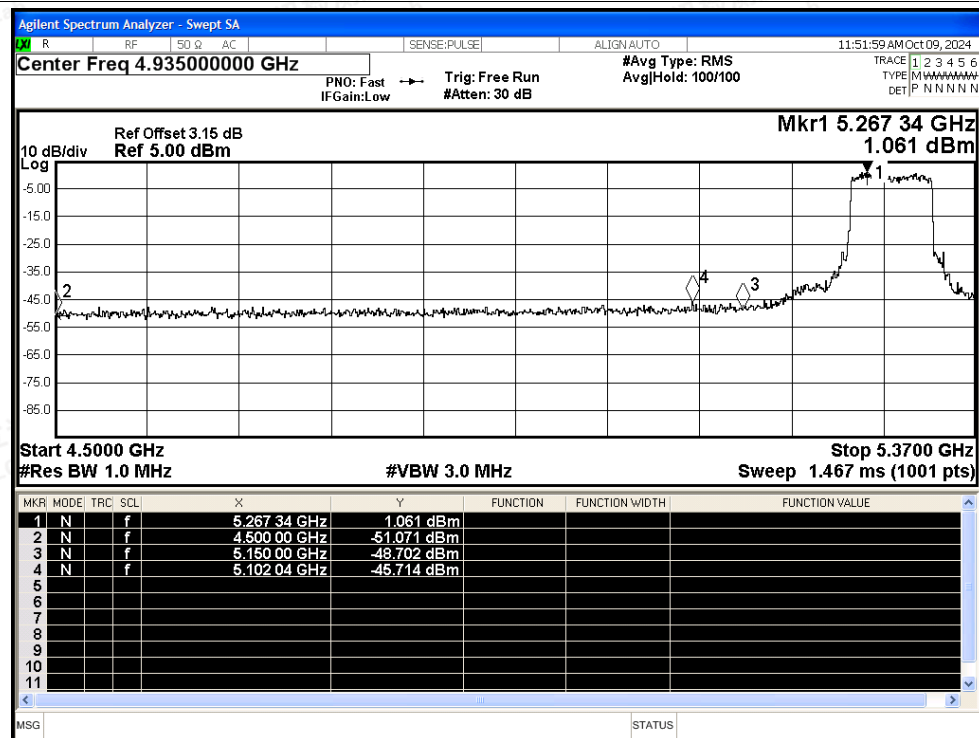

Restrict Band NVNT ax80 5290MHz Ant0 Average

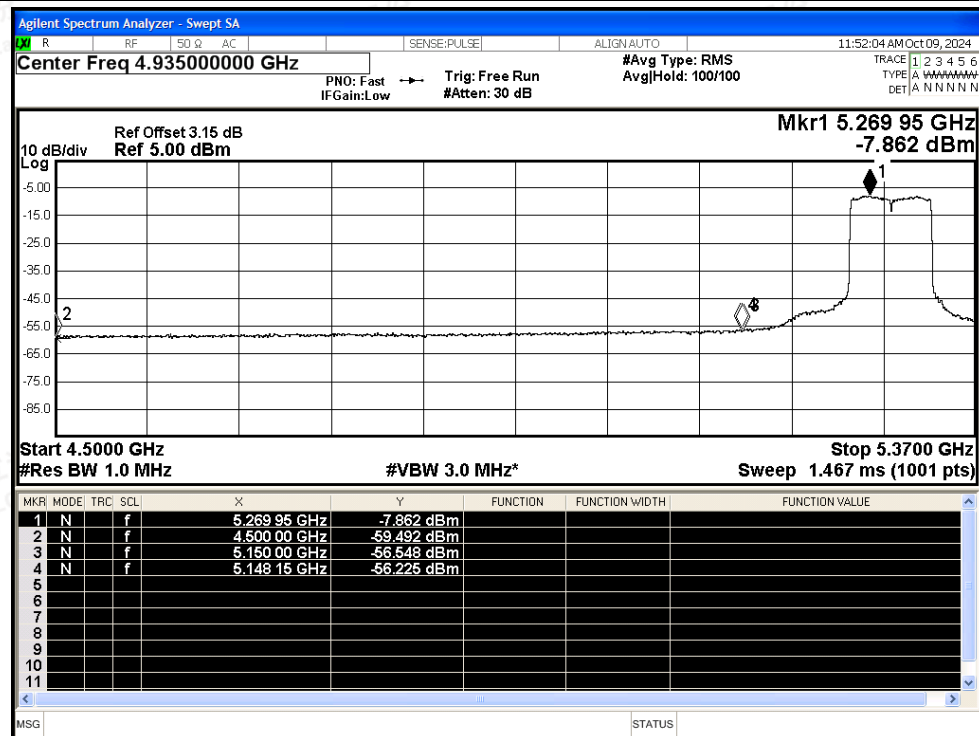

Restrict Band NVNT ax160 5250MHz Ant0 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

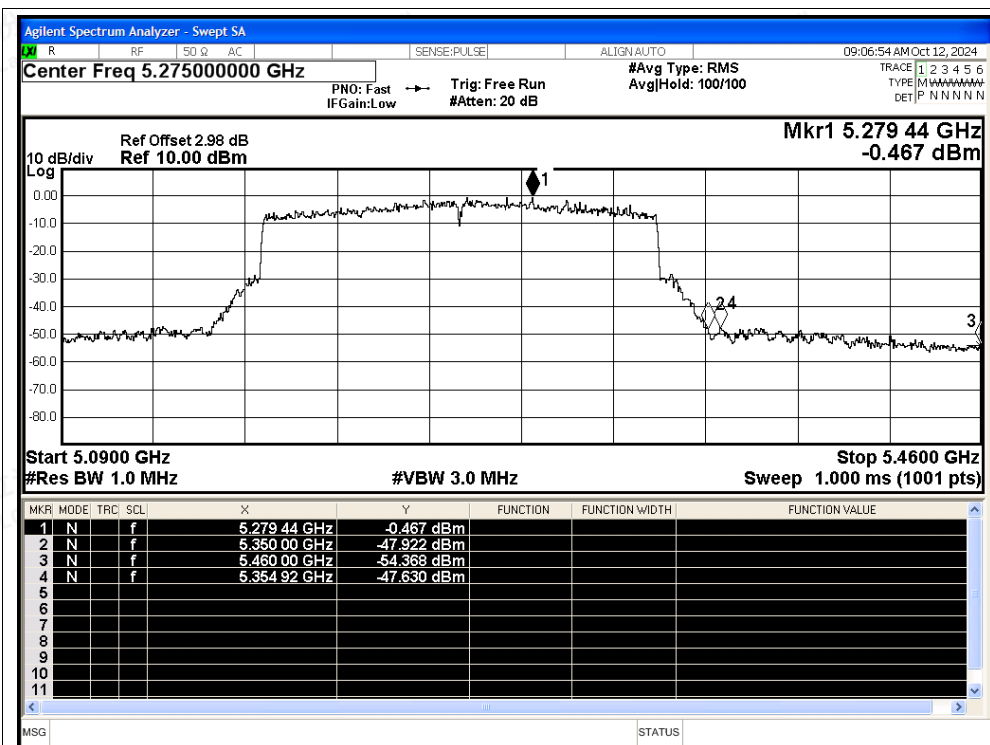

Restrict Band NVNT ax160 5250MHz Ant0 Average

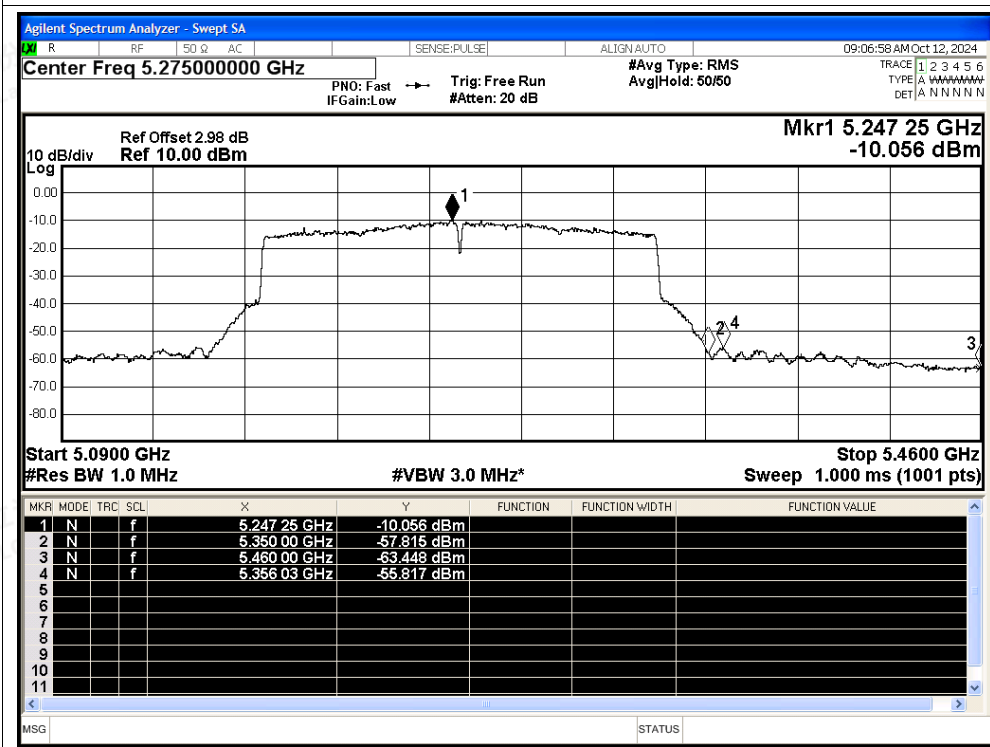

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant0 Peak

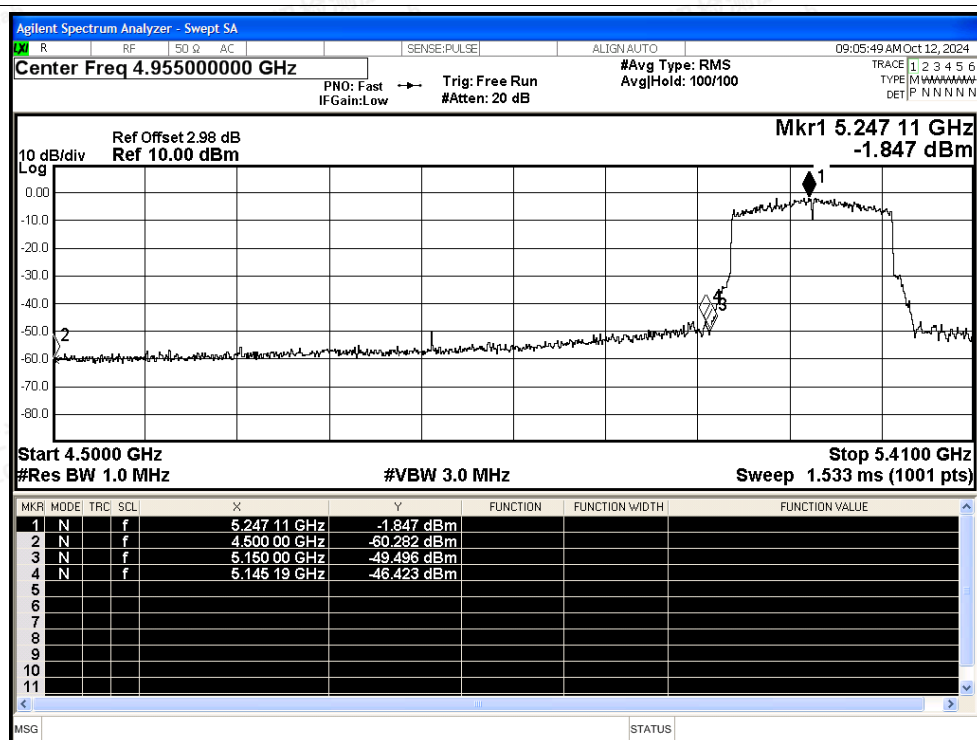

Restrict Band NVNT ax160 5250MHz Ant0 Average

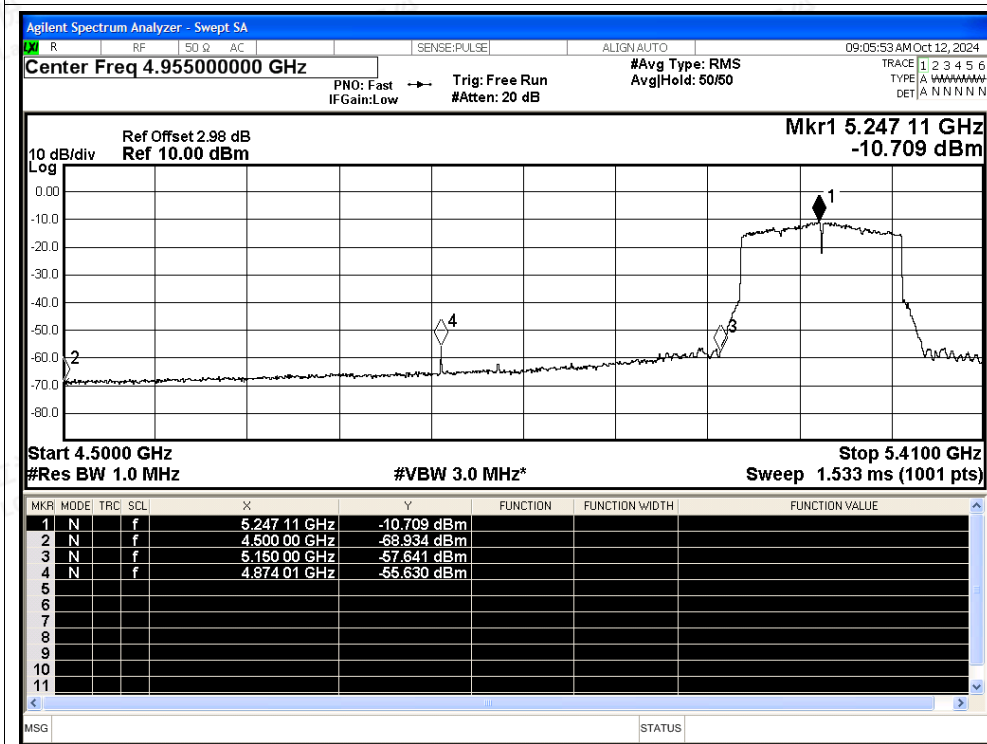

Condition	Mode	Frequency	Antenna	Spur Freq	Power	Gain	Duty	E	Detector	Limit	Verdict
-----------	------	-----------	---------	-----------	-------	------	------	---	----------	-------	---------



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



		(MHz)		(MHz)	(dBm)	(dBi)	Factor (dB)	(dBuV/m)		(dBuV/m)	
NVNT	a	5260	Ant1	4500	-51.47	3.09	-	46.85	Peak	68.2	Pass
NVNT	a	5260	Ant1	4500	-59.01	3.09	0.24	39.55	Average	54	Pass
NVNT	a	5260	Ant1	4997.64	-46.03	3.09	-	52.29	Peak	68.2	Pass
NVNT	a	5260	Ant1	4787.82	-55.58	3.09	0.24	42.98	Average	54	Pass
NVNT	a	5260	Ant1	5150	-48.83	3.09	-	49.49	Peak	68.2	Pass
NVNT	a	5260	Ant1	5150	-56.36	3.09	0.24	42.2	Average	54	Pass
NVNT	a	5320	Ant1	5350	-45.75	3.09	-	52.57	Peak	68.2	Pass
NVNT	a	5320	Ant1	5350	-56.05	3.09	0.24	42.51	Average	54	Pass
NVNT	a	5320	Ant1	5351.2	-42.33	3.09	-	55.99	Peak	68.2	Pass
NVNT	a	5320	Ant1	5350.4	-55.45	3.09	0.24	43.11	Average	54	Pass
NVNT	a	5320	Ant1	5460	-50.74	3.09	-	47.58	Peak	68.2	Pass
NVNT	a	5320	Ant1	5460	-57.43	3.09	0.24	41.13	Average	54	Pass
NVNT	n20	5260	Ant1	4500	-50.75	3.09	-	47.57	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4500	-59.54	3.09	0.12	38.9	Average	54	Pass
NVNT	n20	5260	Ant1	5093.58	-46.28	3.09	-	52.04	Peak	68.2	Pass
NVNT	n20	5260	Ant1	4787.04	-55.55	3.09	0.12	42.89	Average	54	Pass
NVNT	n20	5260	Ant1	5150	-48.65	3.09	-	49.67	Peak	68.2	Pass
NVNT	n20	5260	Ant1	5150	-56.78	3.09	0.12	41.66	Average	54	Pass
NVNT	n20	5320	Ant1	5350	-42.57	3.09	-	55.75	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5350	-55.09	3.09	0.12	43.35	Average	54	Pass
NVNT	n20	5320	Ant1	5351.8	-39.85	3.09	-	58.47	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5350.2	-54.72	3.09	0.12	43.72	Average	54	Pass
NVNT	n20	5320	Ant1	5460	-48.56	3.09	-	49.76	Peak	68.2	Pass
NVNT	n20	5320	Ant1	5460	-58	3.09	0.12	40.44	Average	54	Pass
NVNT	n40	5270	Ant1	4500	-48.16	3.09	-	50.16	Peak	68.2	Pass
NVNT	n40	5270	Ant1	4500	-58.97	3.09	0.12	39.47	Average	54	Pass
NVNT	n40	5270	Ant1	4805.37	-44.66	3.09	-	53.66	Peak	68.2	Pass
NVNT	n40	5270	Ant1	4806.99	-53.2	3.09	0.12	45.24	Average	54	Pass
NVNT	n40	5270	Ant1	5150	-48.76	3.09	-	49.56	Peak	68.2	Pass
NVNT	n40	5270	Ant1	5150	-57.11	3.09	0.12	41.33	Average	54	Pass
NVNT	n40	5310	Ant1	5350	-46.43	3.09	-	51.89	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350	-55.6	3.09	0.12	42.84	Average	54	Pass
NVNT	n40	5310	Ant1	5350.8	-43.05	3.09	-	55.27	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5350.6	-54.89	3.09	0.12	43.55	Average	54	Pass
NVNT	n40	5310	Ant1	5460	-50.08	3.09	-	48.24	Peak	68.2	Pass
NVNT	n40	5310	Ant1	5460	-57.73	3.09	0.12	40.71	Average	54	Pass
NVNT	ac20	5260	Ant1	4500	-50.59	3.09	-	47.73	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	4500	-59.27	3.09	0.12	39.17	Average	54	Pass
NVNT	ac20	5260	Ant1	4978.92	-46.21	3.09	-	52.11	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	4787.82	-55.11	3.09	0.12	43.33	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant1	5150	-48.81	3.09	-	49.51	Peak	68.2	Pass
NVNT	ac20	5260	Ant1	5150	-56.95	3.09	0.12	41.49	Average	54	Pass
NVNT	ac20	5320	Ant1	5350	-45	3.09	-	53.32	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5350	-55.3	3.09	0.12	43.14	Average	54	Pass
NVNT	ac20	5320	Ant1	5351	-38.65	3.09	-	59.67	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5351.6	-54.59	3.09	0.12	43.85	Average	54	Pass
NVNT	ac20	5320	Ant1	5460	-50.12	3.09	-	48.2	Peak	68.2	Pass
NVNT	ac20	5320	Ant1	5460	-58.51	3.09	0.12	39.93	Average	54	Pass
NVNT	ac40	5270	Ant1	4500	-51.23	3.09	-	47.09	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4500	-58.98	3.09	0.12	39.46	Average	54	Pass
NVNT	ac40	5270	Ant1	4806.18	-43.79	3.09	-	54.53	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	4806.99	-52.57	3.09	0.12	45.87	Average	54	Pass
NVNT	ac40	5270	Ant1	5150	-48.3	3.09	-	50.02	Peak	68.2	Pass
NVNT	ac40	5270	Ant1	5150	-57.55	3.09	0.12	40.89	Average	54	Pass
NVNT	ac40	5310	Ant1	5350	-44.33	3.09	-	53.99	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5350	-55.61	3.09	0.12	42.83	Average	54	Pass
NVNT	ac40	5310	Ant1	5350.6	-40.02	3.09	-	58.3	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5351.2	-54.82	3.09	0.12	43.62	Average	54	Pass
NVNT	ac40	5310	Ant1	5460	-50.97	3.09	-	47.35	Peak	68.2	Pass
NVNT	ac40	5310	Ant1	5460	-57.87	3.09	0.12	40.57	Average	54	Pass
NVNT	ac80	5290	Ant1	4500	-50.72	3.09	-	47.6	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	4500	-58.95	3.09	0.25	39.62	Average	54	Pass
NVNT	ac80	5290	Ant1	5109	-46.38	3.09	-	51.94	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5139.45	-56.23	3.09	0.25	42.34	Average	54	Pass
NVNT	ac80	5290	Ant1	5150	-48.6	3.09	-	49.72	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5150	-56.96	3.09	0.25	41.61	Average	54	Pass
NVNT	ac80	5290	Ant1	5350	-46.43	3.09	-	51.89	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5350	-54.42	3.09	0.25	44.15	Average	54	Pass
NVNT	ac80	5290	Ant1	5354.5	-41.23	3.09	-	57.09	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5351.25	-54.25	3.09	0.25	44.32	Average	54	Pass
NVNT	ac80	5290	Ant1	5460	-48.12	3.09	-	50.2	Peak	68.2	Pass
NVNT	ac80	5290	Ant1	5460	-57.29	3.09	0.25	41.28	Average	54	Pass
NVNT	ac160	5250	Ant1	5350	-50.61	3.09	-	47.71	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5350	-58.07	3.09	0.41	40.66	Average	54	Pass
NVNT	ac160	5250	Ant1	5354.92	-46.69	3.09	-	51.63	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5356.4	-55.73	3.09	0.41	43.00	Average	54	Pass
NVNT	ac160	5250	Ant1	5460	-56.25	3.09	-	42.07	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5460	-64.94	3.09	0.41	33.79	Average	54	Pass
NVNT	ac160	5250	Ant1	4500	-60.46	3.09	-	37.86	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4500	-69.23	3.09	0.41	29.50	Average	54	Pass
NVNT	ac160	5250	Ant1	5146.1	-48.4	3.09	-	49.92	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	4874.01	-54.62	3.09	0.41	44.11	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant1	5150	-52.6	3.09	-	45.72	Peak	68.2	Pass
NVNT	ac160	5250	Ant1	5150	-58.89	3.09	0.41	39.84	Average	54	Pass
NVNT	ax20	5260	Ant1	4500	-51.4	3.09	-	46.92	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	4500	-59.34	3.09	0.12	39.1	Average	54	Pass
NVNT	ax20	5260	Ant1	5031.18	-46.55	3.09	-	51.77	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	4787.82	-55.4	3.09	0.12	43.04	Average	54	Pass
NVNT	ax20	5260	Ant1	5150	-48.2	3.09	-	50.12	Peak	68.2	Pass
NVNT	ax20	5260	Ant1	5150	-56.67	3.09	0.12	41.77	Average	54	Pass
NVNT	ax20	5320	Ant1	5350	-45.4	3.09	-	52.92	Peak	68.2	Pass
NVNT	ax20	5320	Ant1	5350	-55.55	3.09	0.12	42.89	Average	54	Pass
NVNT	ax20	5320	Ant1	5350.2	-41.1	3.09	-	57.22	Peak	68.2	Pass
NVNT	ax20	5320	Ant1	5350.2	-54.8	3.09	0.12	43.64	Average	54	Pass
NVNT	ax20	5320	Ant1	5460	-49.6	3.09	-	48.72	Peak	68.2	Pass
NVNT	ax20	5320	Ant1	5460	-58.3	3.09	0.12	40.14	Average	54	Pass
NVNT	ax40	5270	Ant1	4500	-50.42	3.09	-	47.9	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	4500	-58.96	3.09	0.12	39.48	Average	54	Pass
NVNT	ax40	5270	Ant1	4807.8	-45.14	3.09	-	53.18	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	4806.99	-52.9	3.09	0.12	45.54	Average	54	Pass
NVNT	ax40	5270	Ant1	5150	-46.56	3.09	-	51.76	Peak	68.2	Pass
NVNT	ax40	5270	Ant1	5150	-56.87	3.09	0.12	41.57	Average	54	Pass
NVNT	ax40	5310	Ant1	5350	-47.68	3.09	-	50.64	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5350	-55.08	3.09	0.12	43.36	Average	54	Pass
NVNT	ax40	5310	Ant1	5352.4	-41.66	3.09	-	56.66	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5350.2	-54.8	3.09	0.12	43.64	Average	54	Pass
NVNT	ax40	5310	Ant1	5460	-50.43	3.09	-	47.89	Peak	68.2	Pass
NVNT	ax40	5310	Ant1	5460	-57.87	3.09	0.12	40.57	Average	54	Pass
NVNT	ax80	5290	Ant1	5350	-40.92	3.09	-	57.4	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5350	-55.01	3.09	0.25	43.56	Average	54	Pass
NVNT	ax80	5290	Ant1	5350	-40.92	3.09	-	57.4	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5350.5	-54.15	3.09	0.25	44.42	Average	54	Pass
NVNT	ax80	5290	Ant1	5460	-50.89	3.09	-	47.43	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5460	-58.16	3.09	0.25	40.41	Average	54	Pass
NVNT	ax80	5290	Ant1	4500	-51.02	3.09	-	47.3	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	4500	-58.51	3.09	0.25	40.06	Average	54	Pass
NVNT	ax80	5290	Ant1	5104.65	-45.94	3.09	-	52.38	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5146.41	-56.1	3.09	0.25	42.47	Average	54	Pass
NVNT	ax80	5290	Ant1	5150	-48.81	3.09	-	49.51	Peak	68.2	Pass
NVNT	ax80	5290	Ant1	5150	-56.21	3.09	0.25	42.36	Average	54	Pass
NVNT	ax160	5250	Ant1	5350	-48.89	3.09	-	49.43	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5350	-57.43	3.09	0.5	41.39	Average	54	Pass
NVNT	ax160	5250	Ant1	5354.92	-45.62	3.09	-	52.70	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5356.4	-56.62	3.09	0.5	42.20	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax160	5250	Ant1	5460	-55.69	3.09	-	42.63	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5460	-63.67	3.09	0.5	35.15	Average	54	Pass
NVNT	ax160	5250	Ant1	4500	-58.89	3.09	-	39.43	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4500	-68.91	3.09	0.5	29.91	Average	54	Pass
NVNT	ax160	5250	Ant1	5132.45	-47.48	3.09	-	50.84	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	4874.01	-55.75	3.09	0.5	43.07	Average	54	Pass
NVNT	ax160	5250	Ant1	5150	-49.63	3.09	-	48.69	Peak	68.2	Pass
NVNT	ax160	5250	Ant1	5150	-58.81	3.09	0.5	40.01	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5260MHz Ant1 Peak

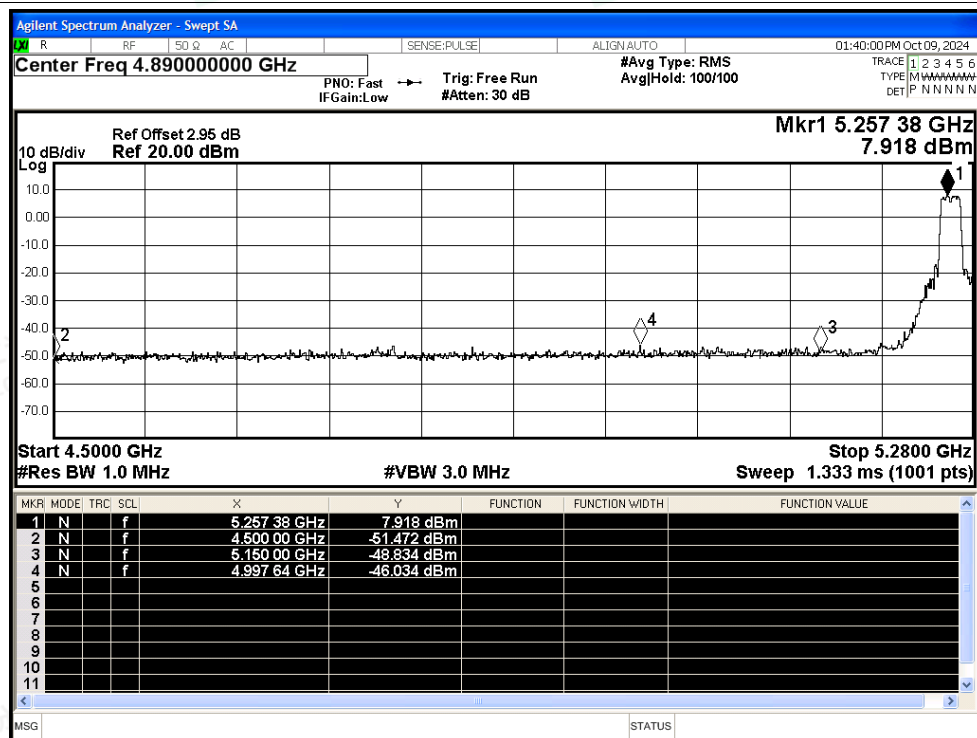

Restrict Band NVNT a 5260MHz Ant1 Average

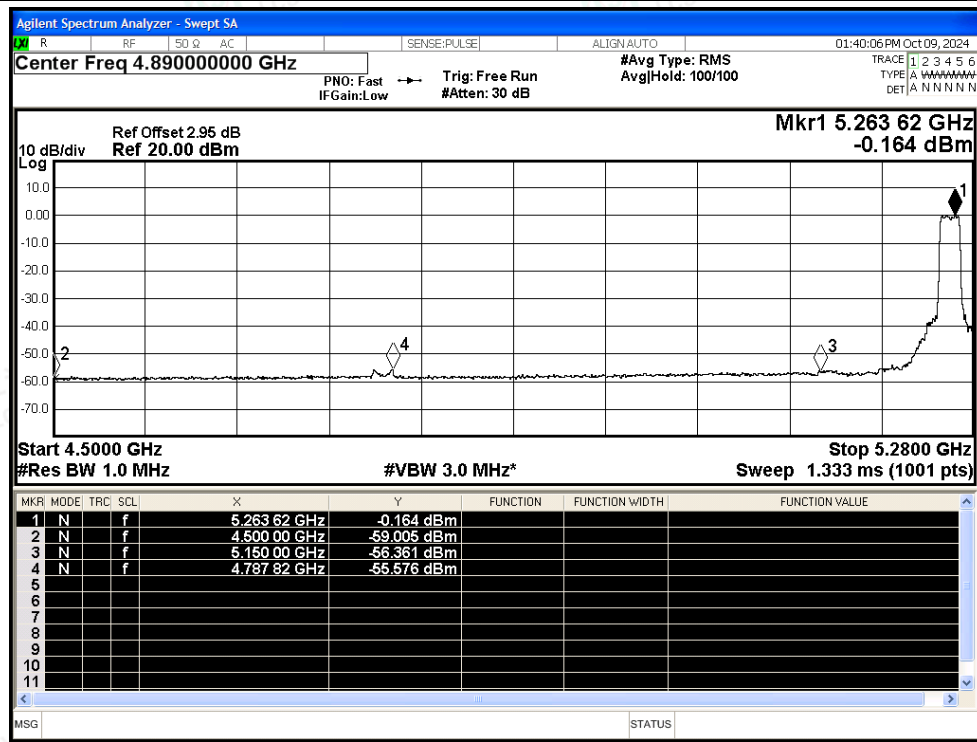

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT a 5320MHz Ant1 Peak

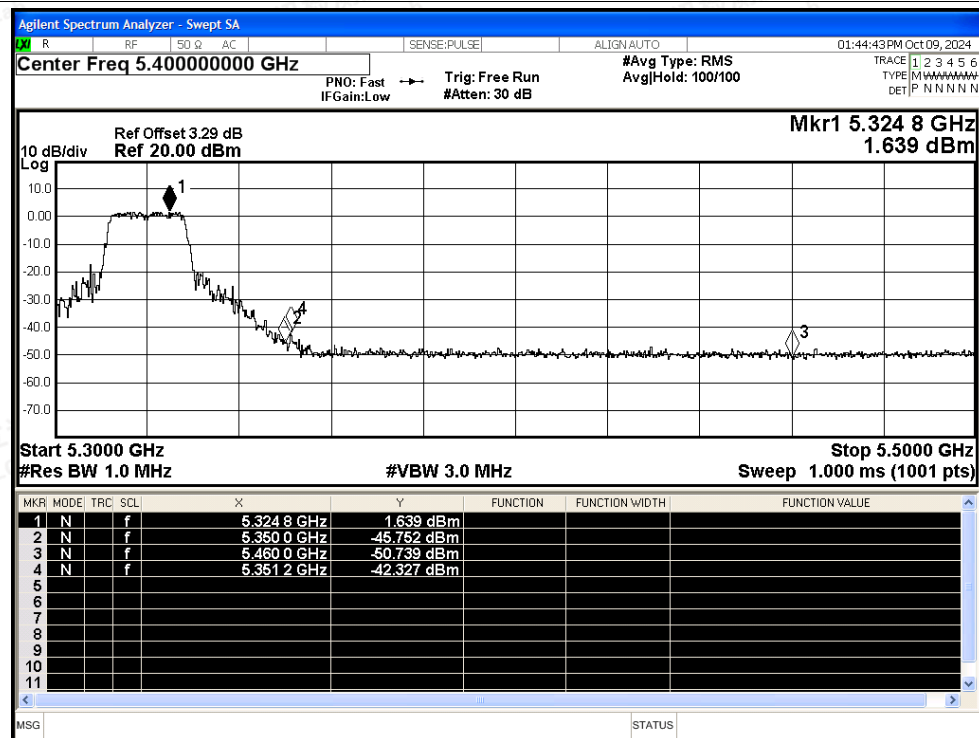


Restrict Band NVNT a 5320MHz Ant1 Average

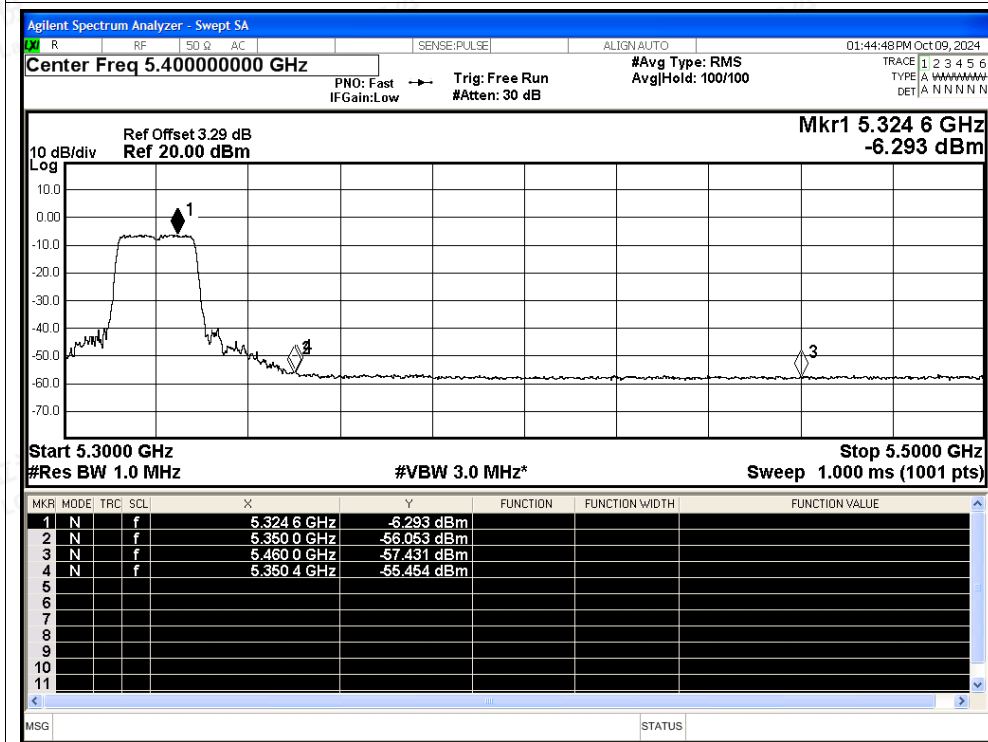


Restrict Band NVNT n20 5260MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

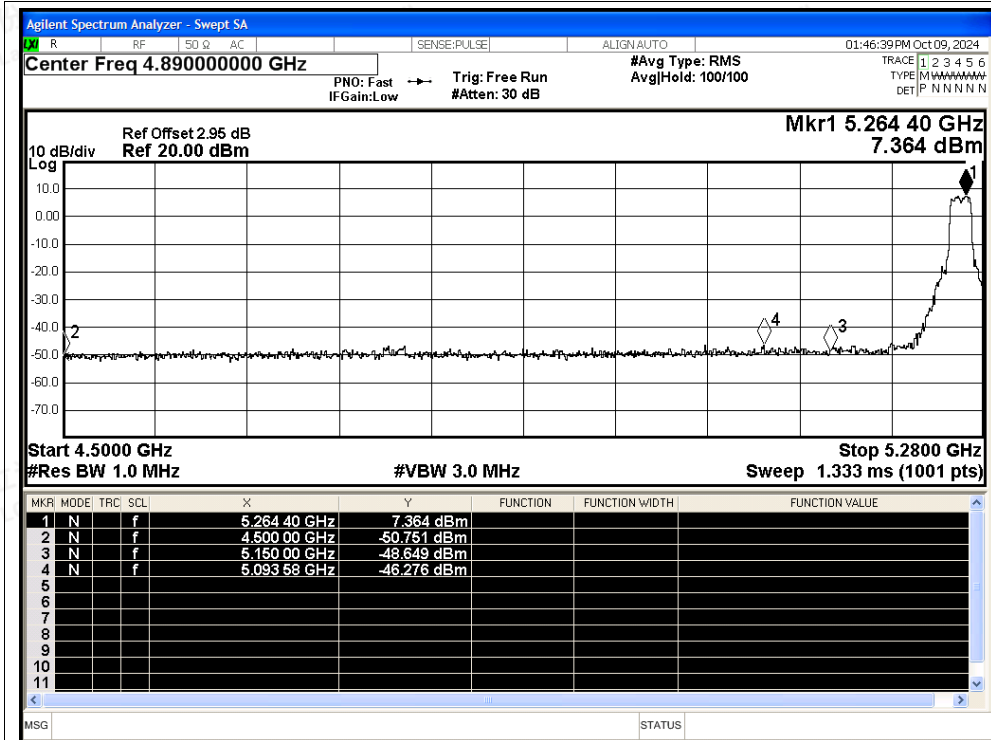


Restrict Band NVNT n20 5260MHz Ant1 Average

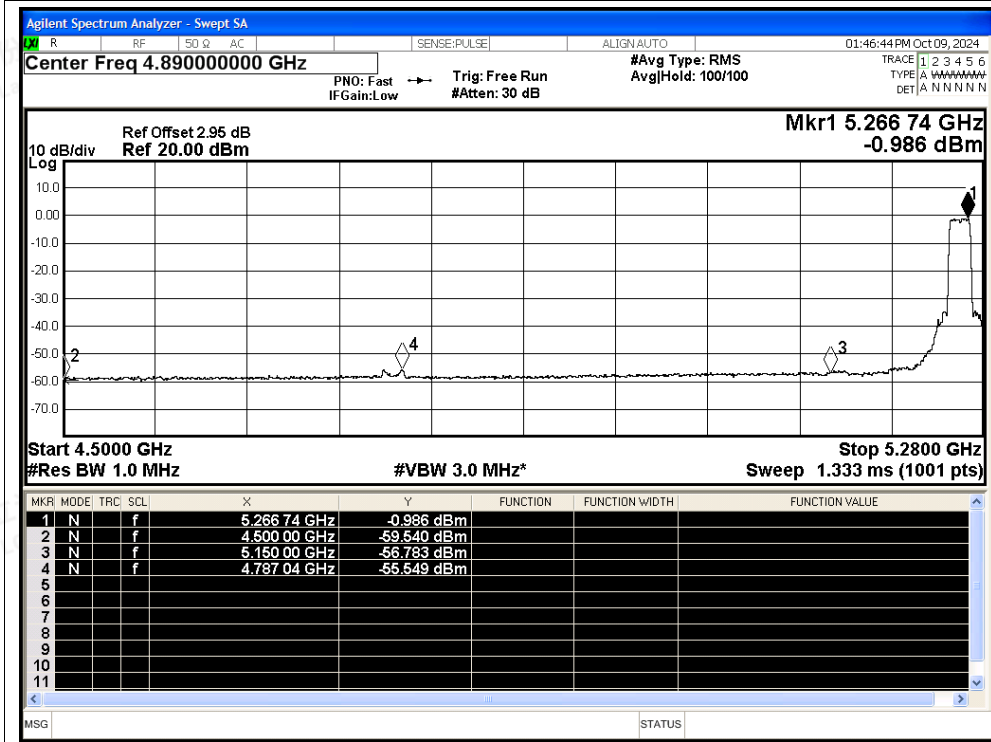


Restrict Band NVNT n20 5320MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

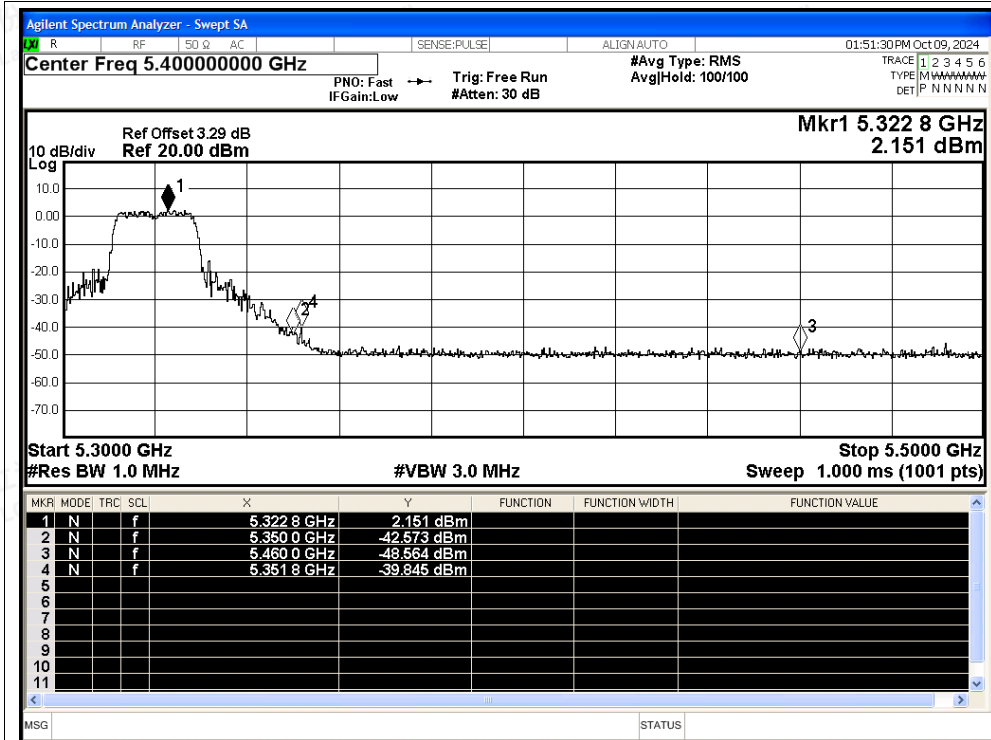


Restrict Band NVNT n20 5320MHz Ant1 Average

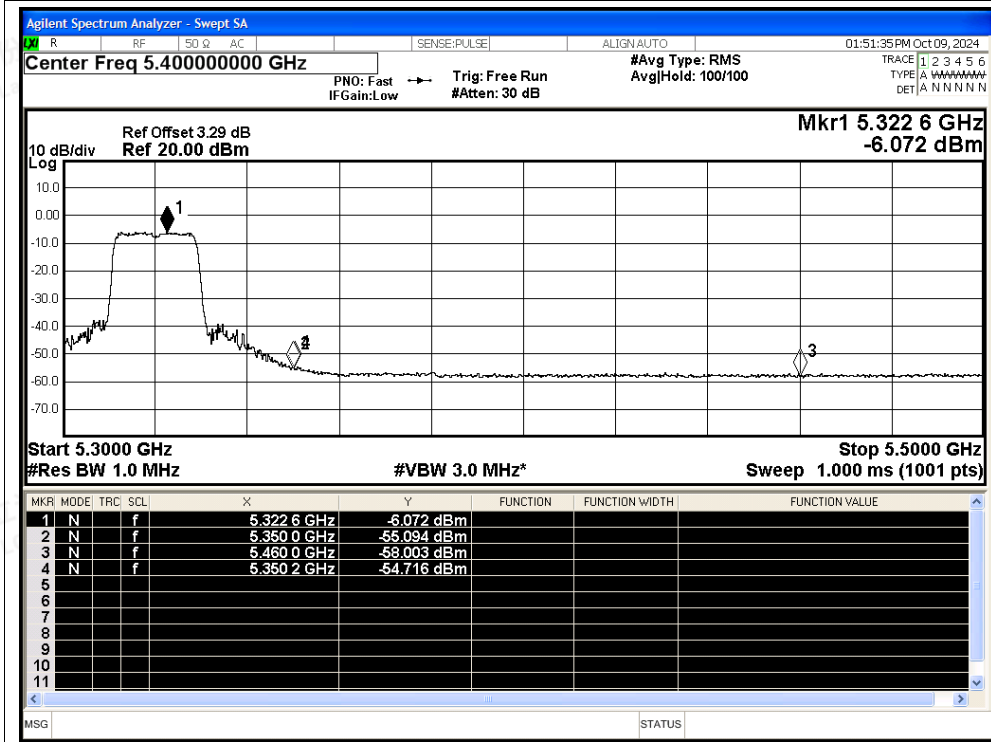


Restrict Band NVNT n40 5270MHz Ant1 Peak



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity

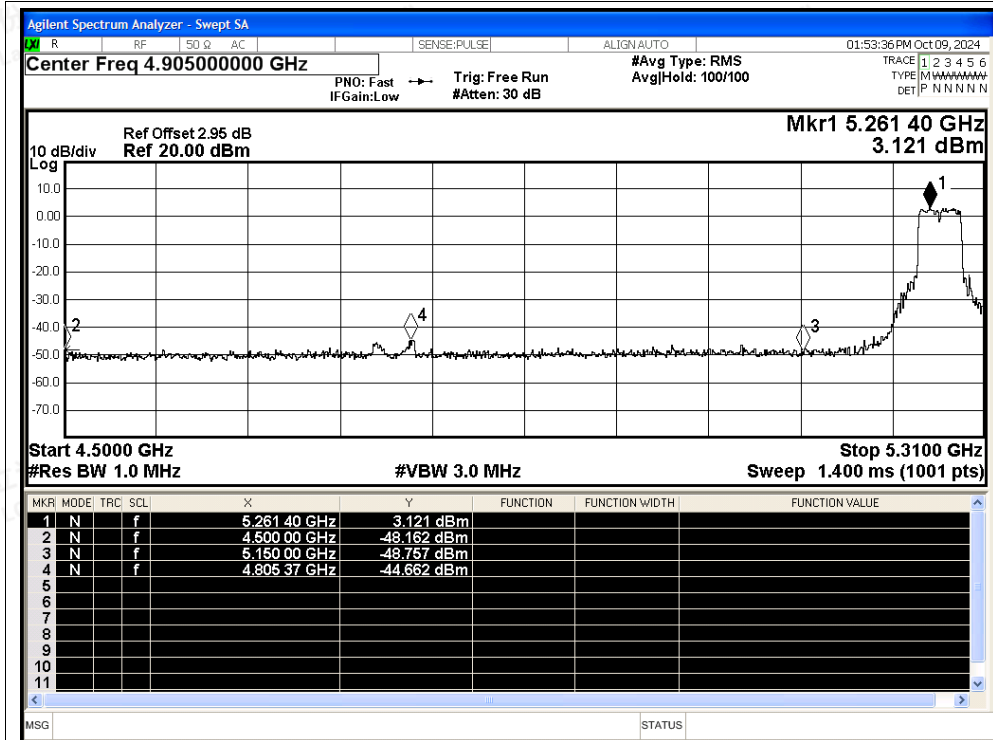

Restrict Band NVNT n40 5270MHz Ant1 Average

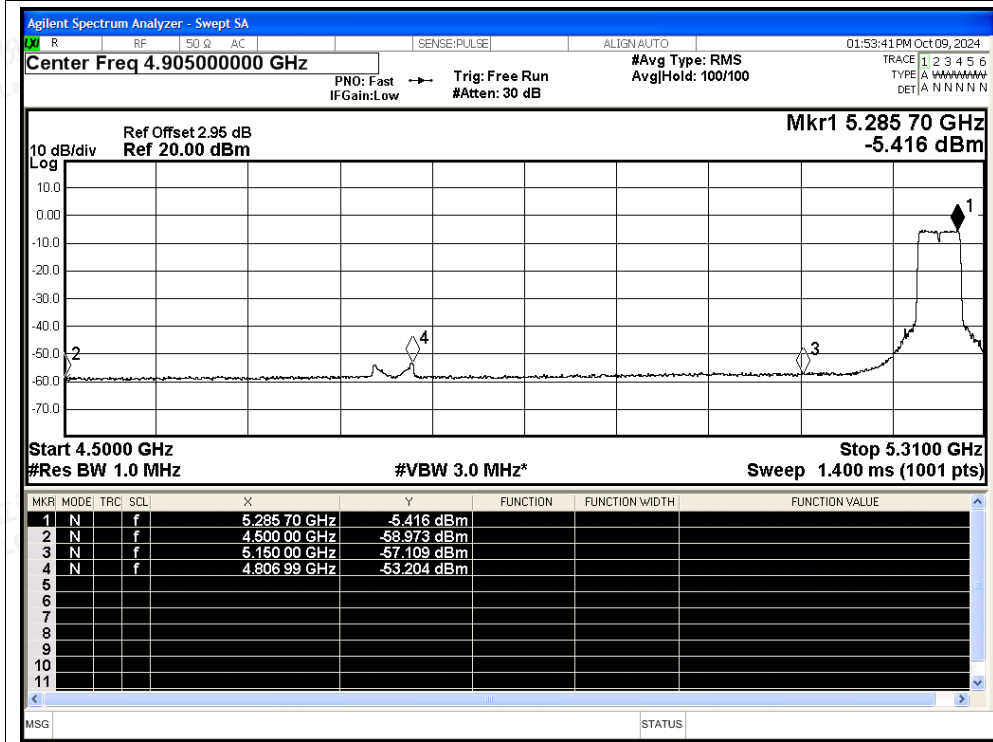

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT n40 5310MHz Ant1 Peak

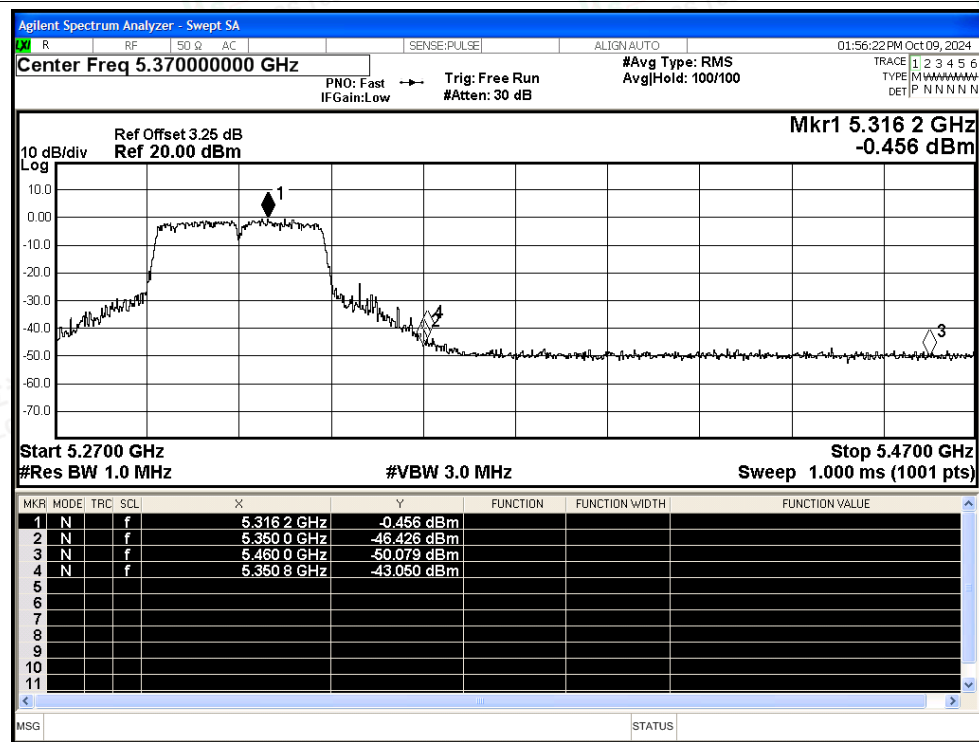

Restrict Band NVNT n40 5310MHz Ant1 Average

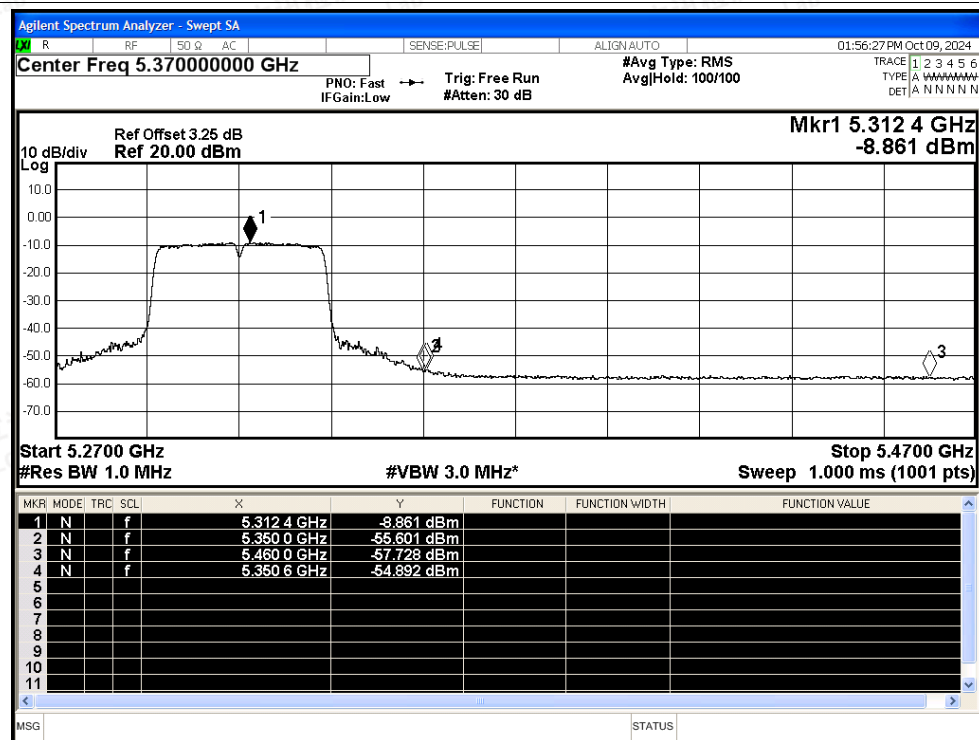


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

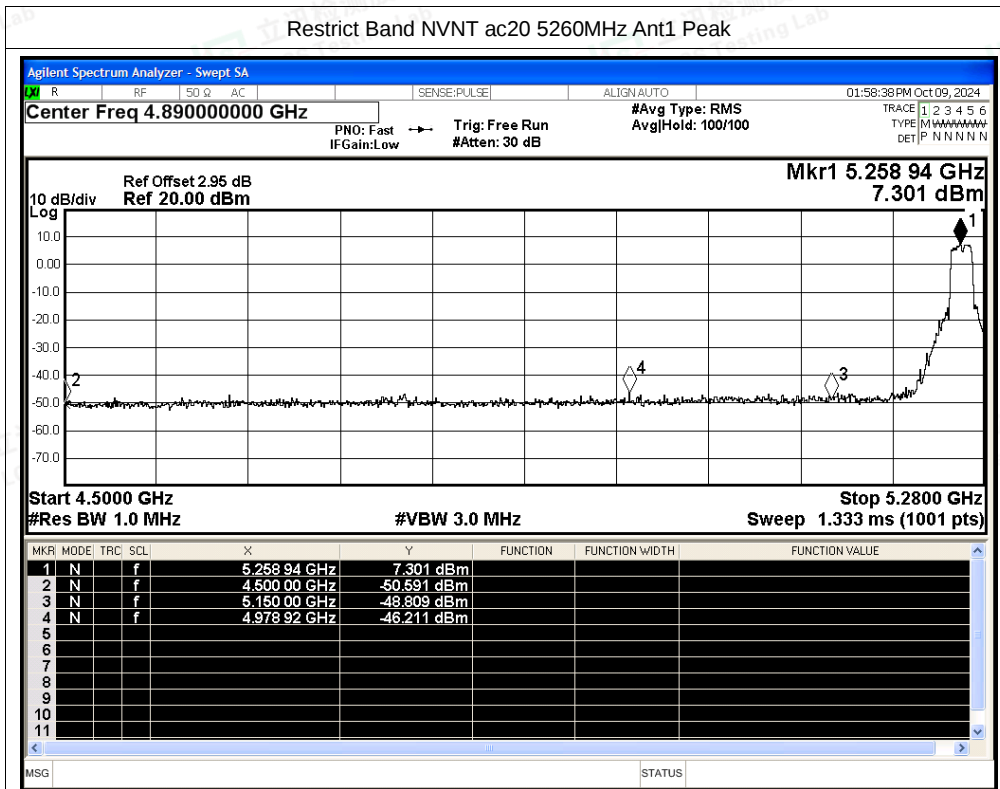


Restrict Band NVNT ac20 5260MHz Ant1 Average

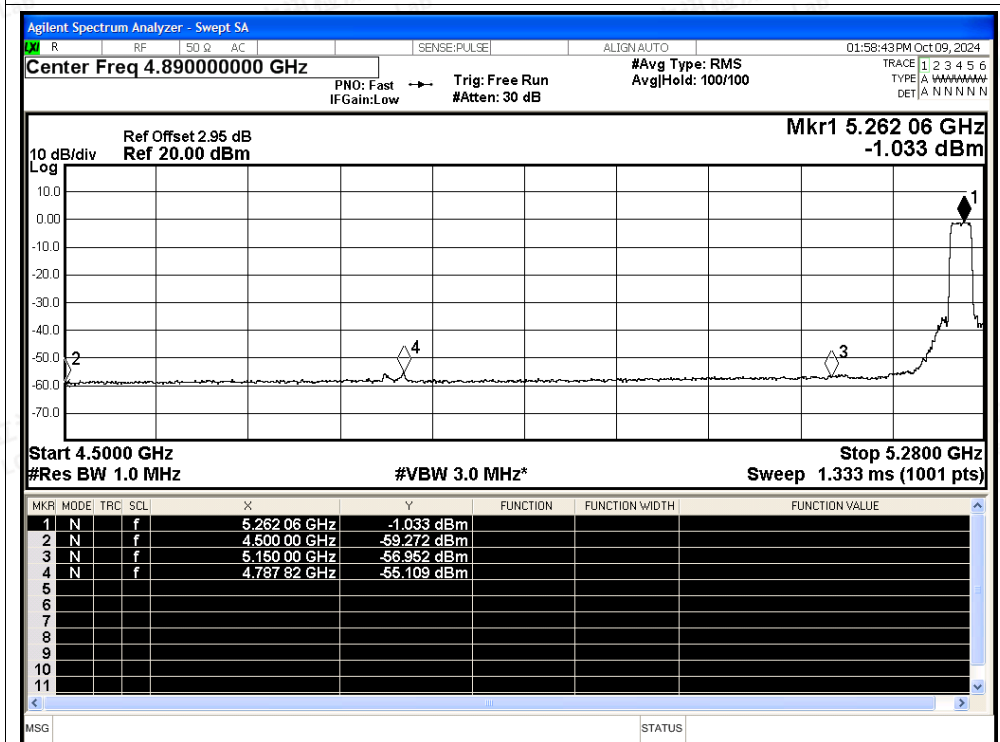




Restrict Band NVNT ac20 5320MHz Ant1 Peak

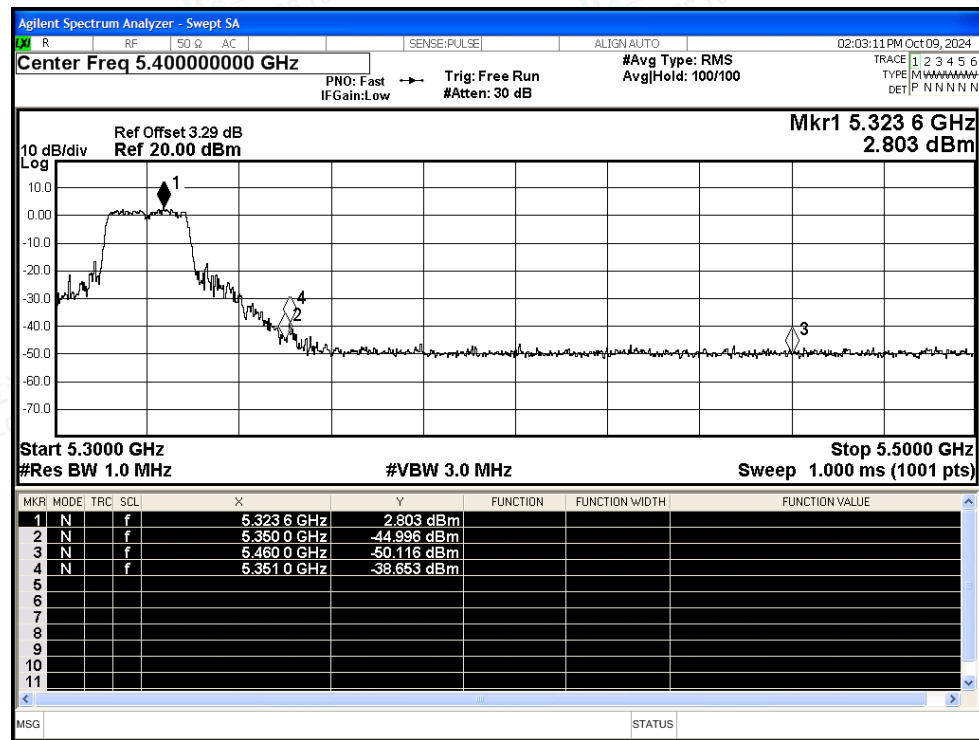

Restrict Band NVNT ac20 5320MHz Ant1 Average


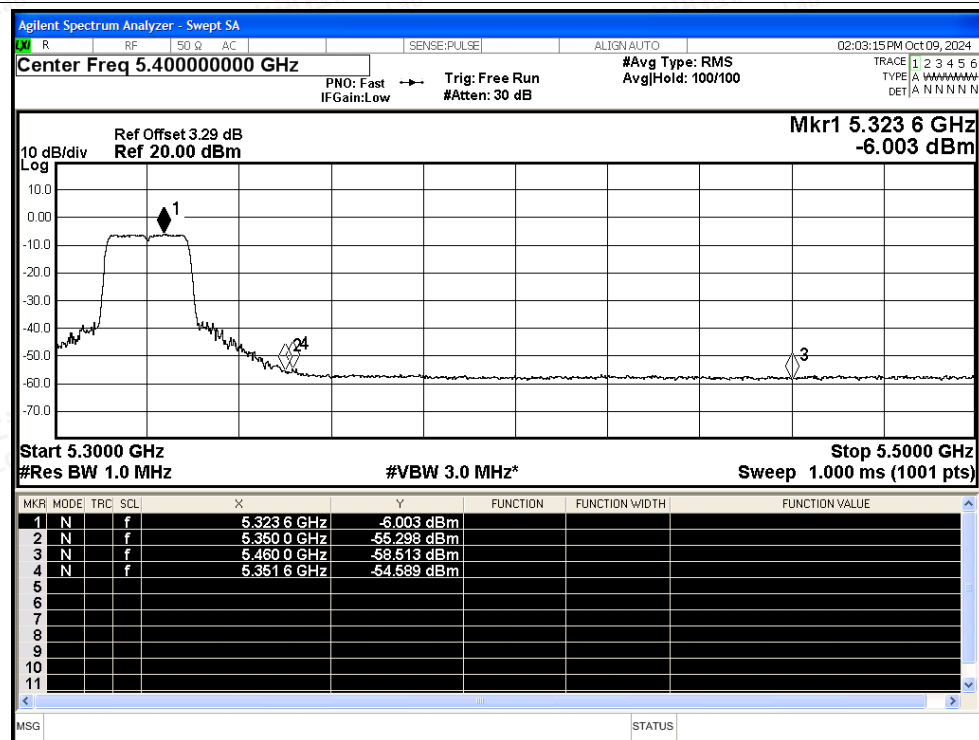


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China


Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

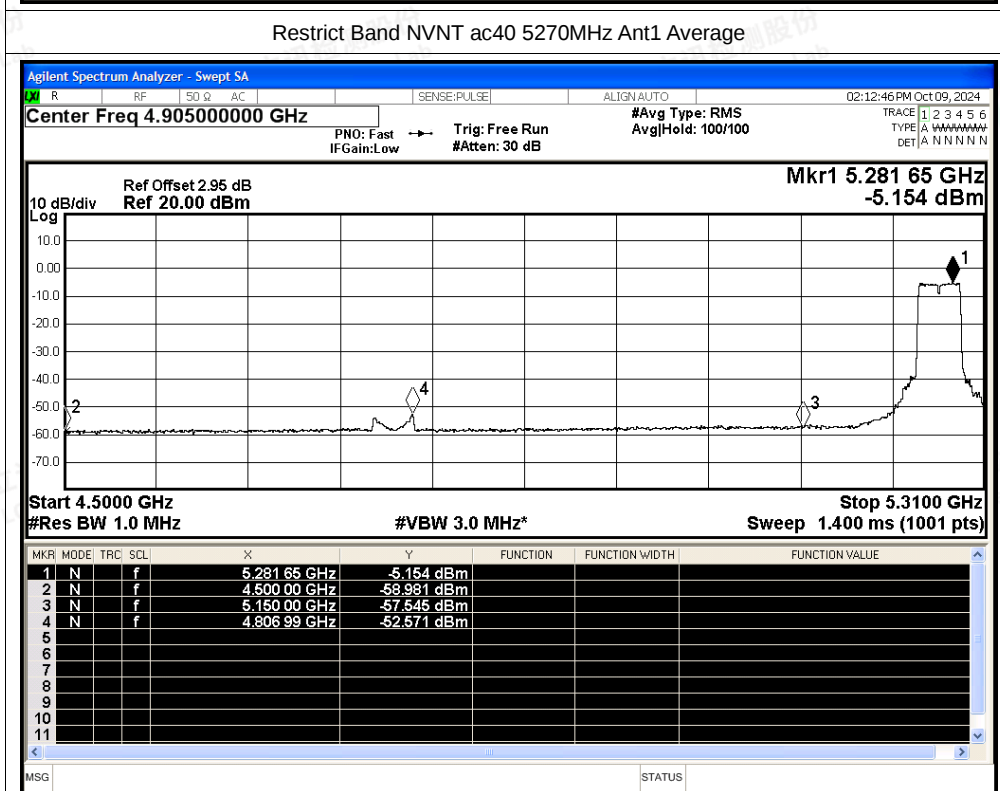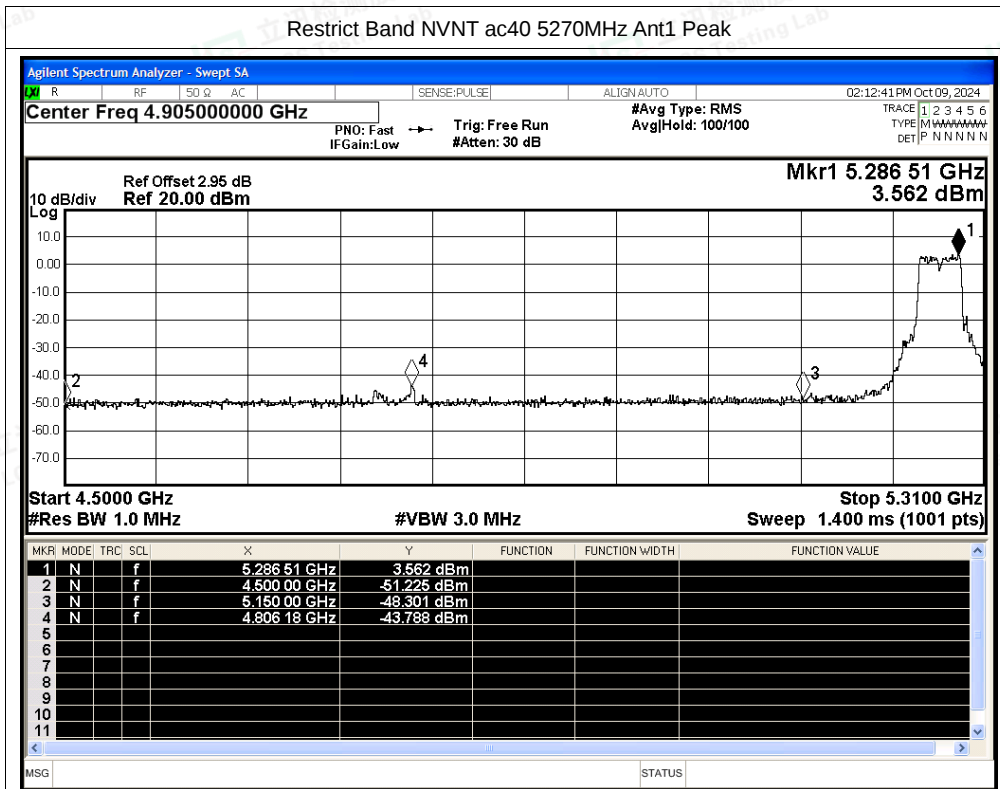




Restrict Band NVNT ac40 5310MHz Ant1 Peak

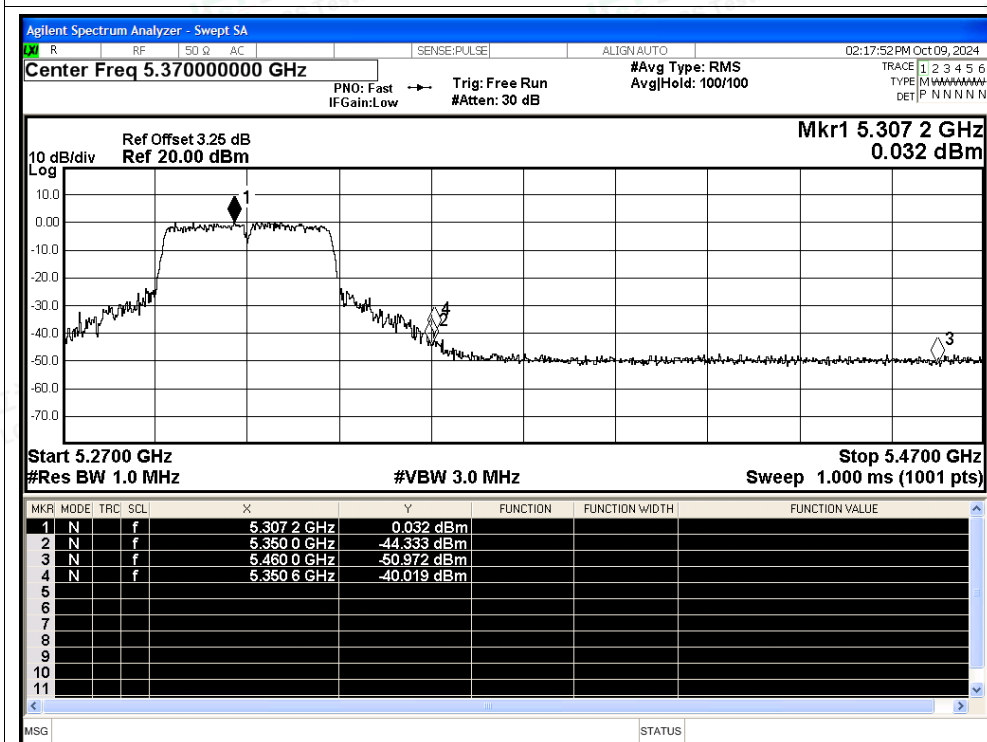

Restrict Band NVNT ac40 5310MHz Ant1 Average

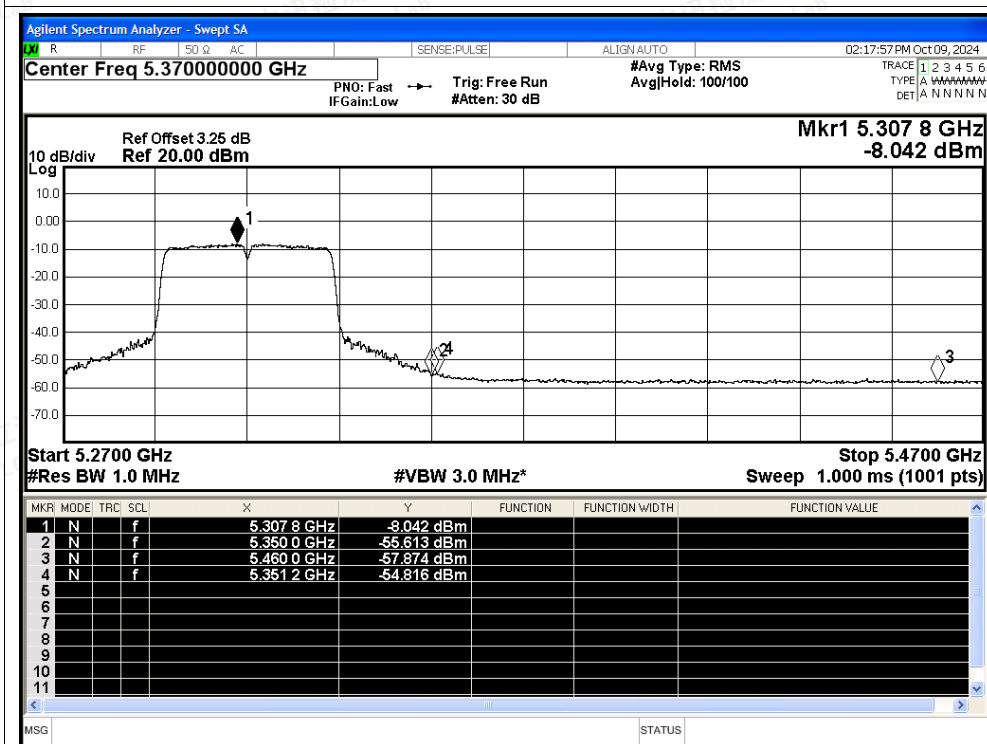


Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

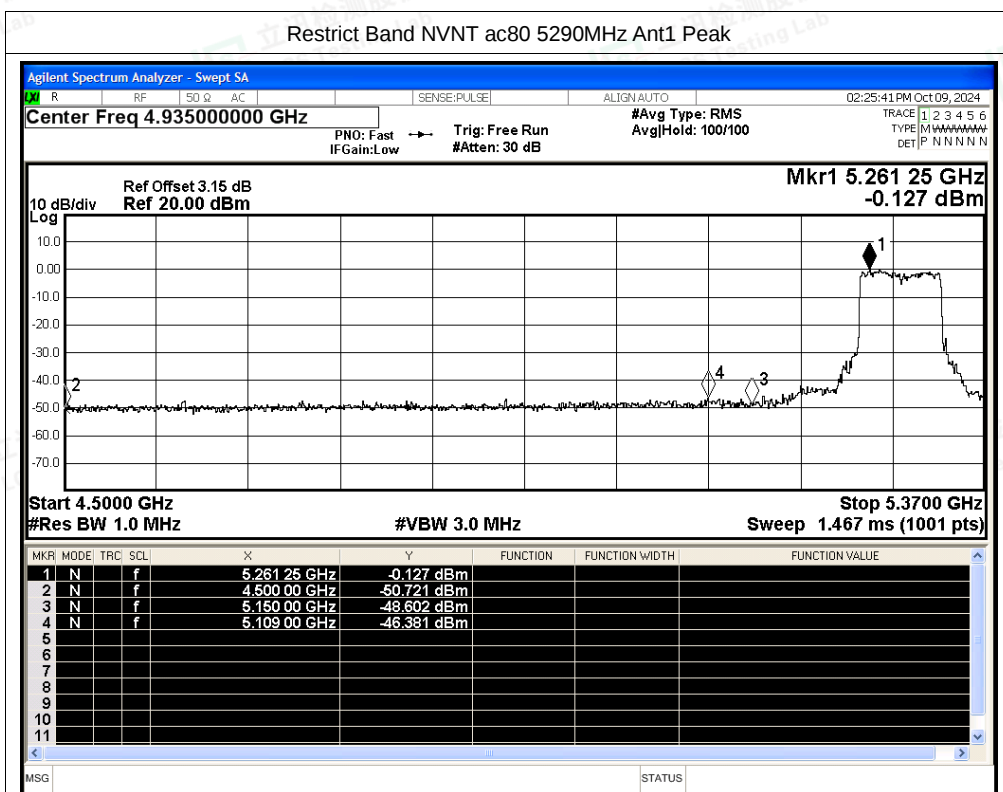

Restrict Band NVNT ac80 5290MHz Ant1 Average

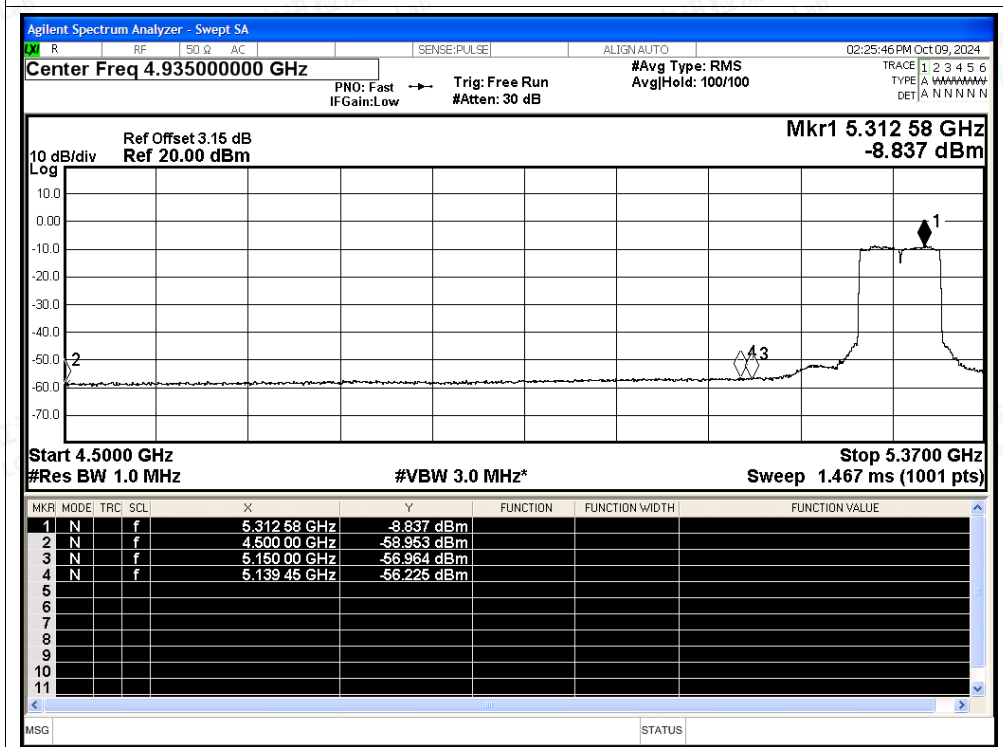

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5290MHz Ant1 Peak

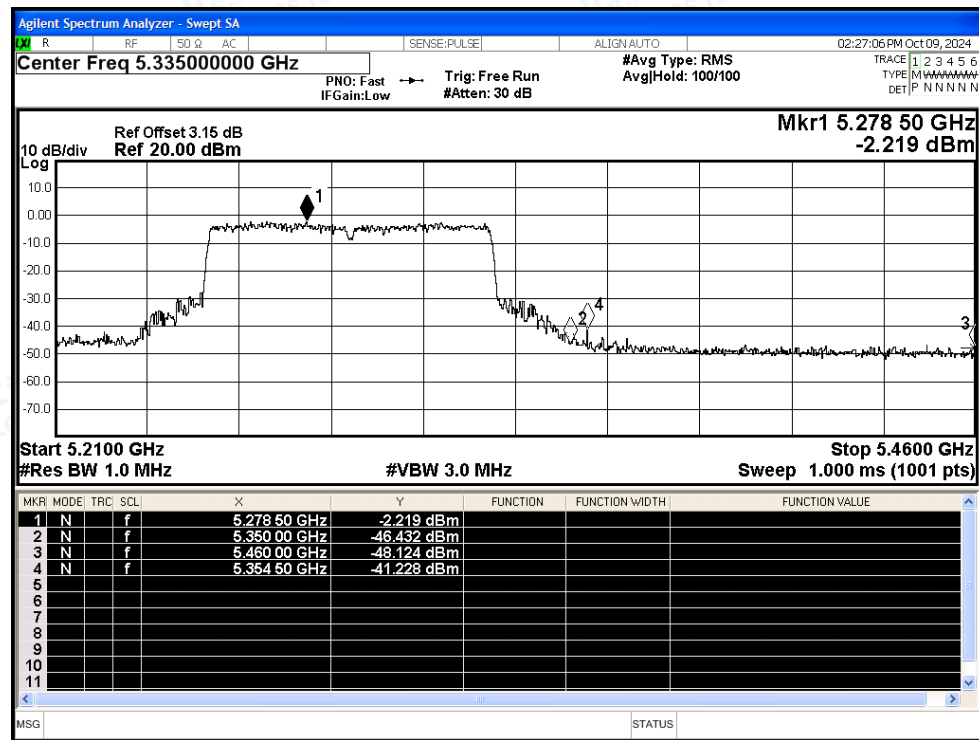


Restrict Band NVNT ac80 5290MHz Ant1 Average

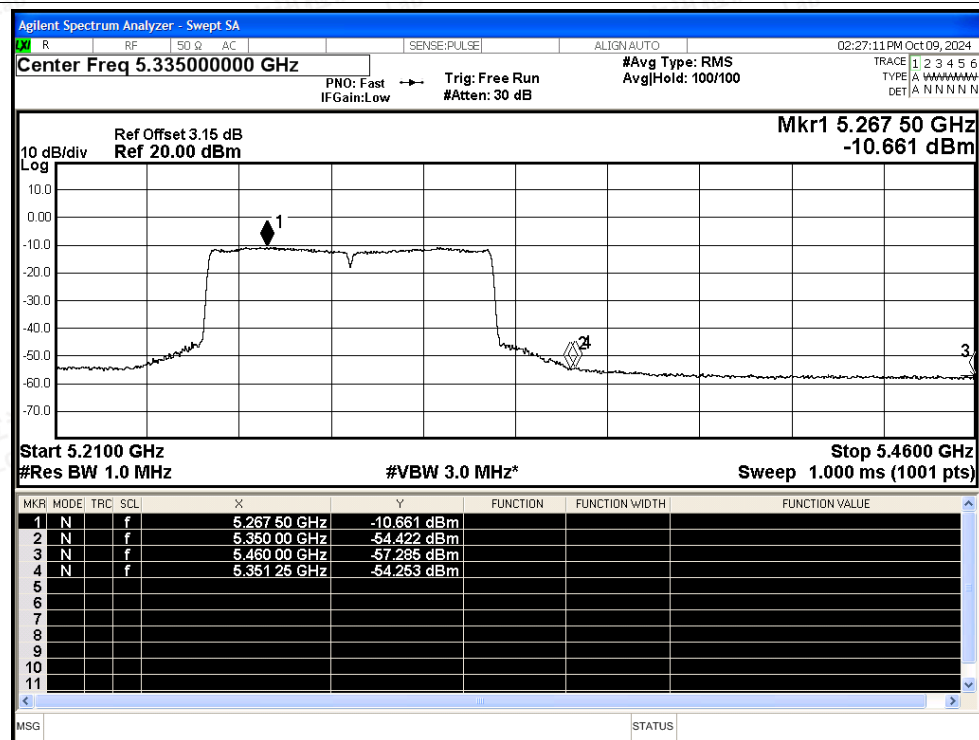




Restrict Band NVNT ac160 5250MHz Ant1 Peak

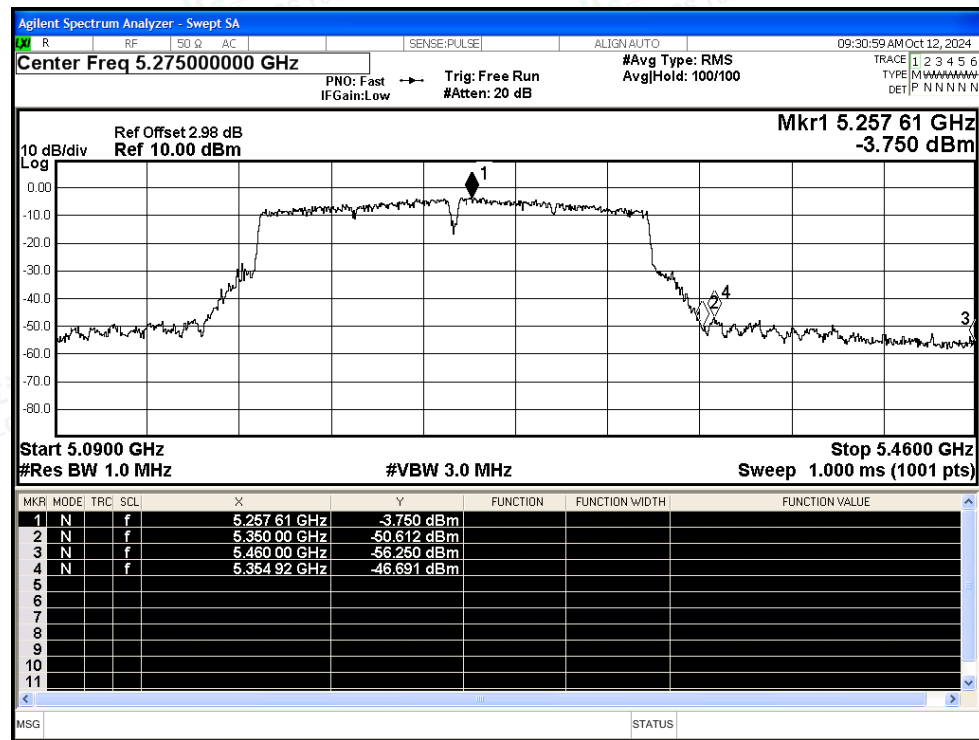

Restrict Band NVNT ac160 5250MHz Ant1 Average

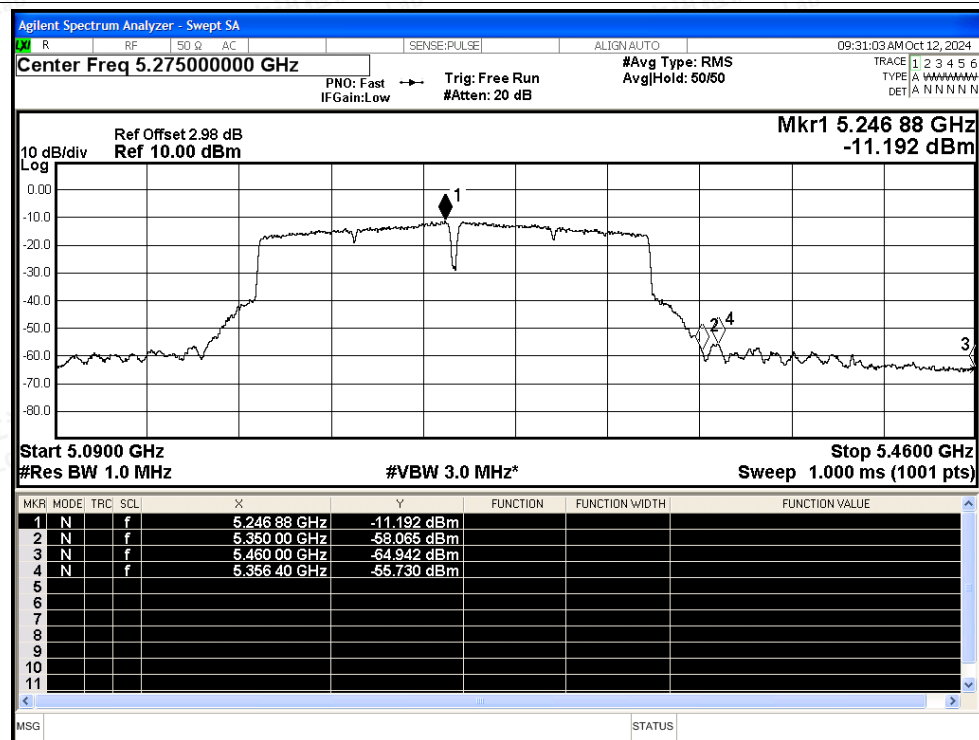

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac160 5250MHz Ant1 Peak

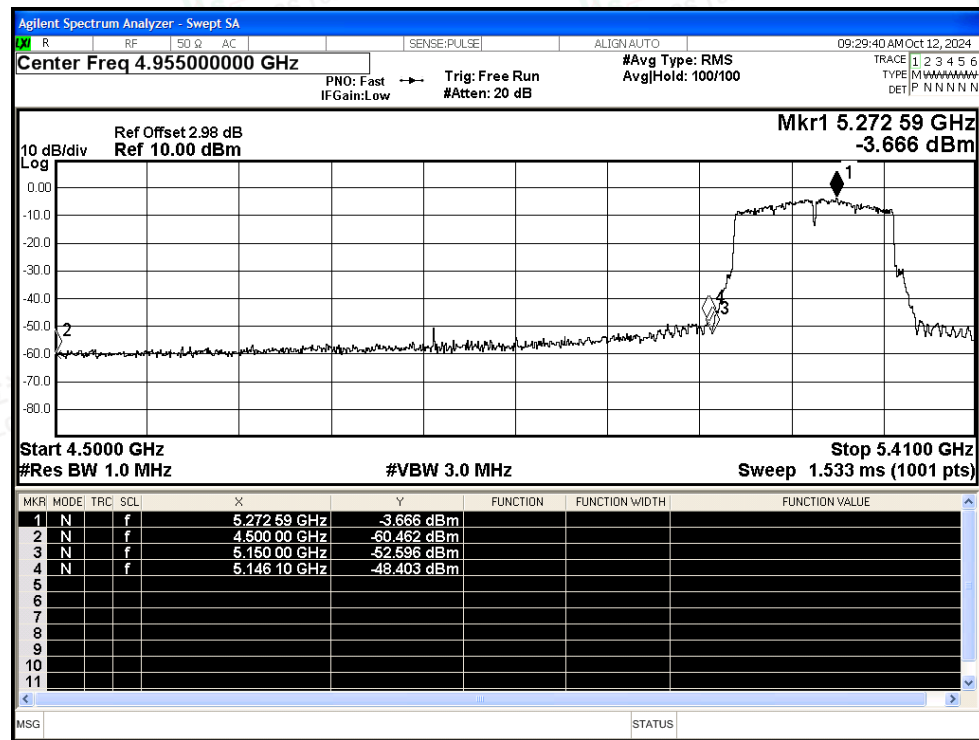

Restrict Band NVNT ac160 5250MHz Ant1 Average

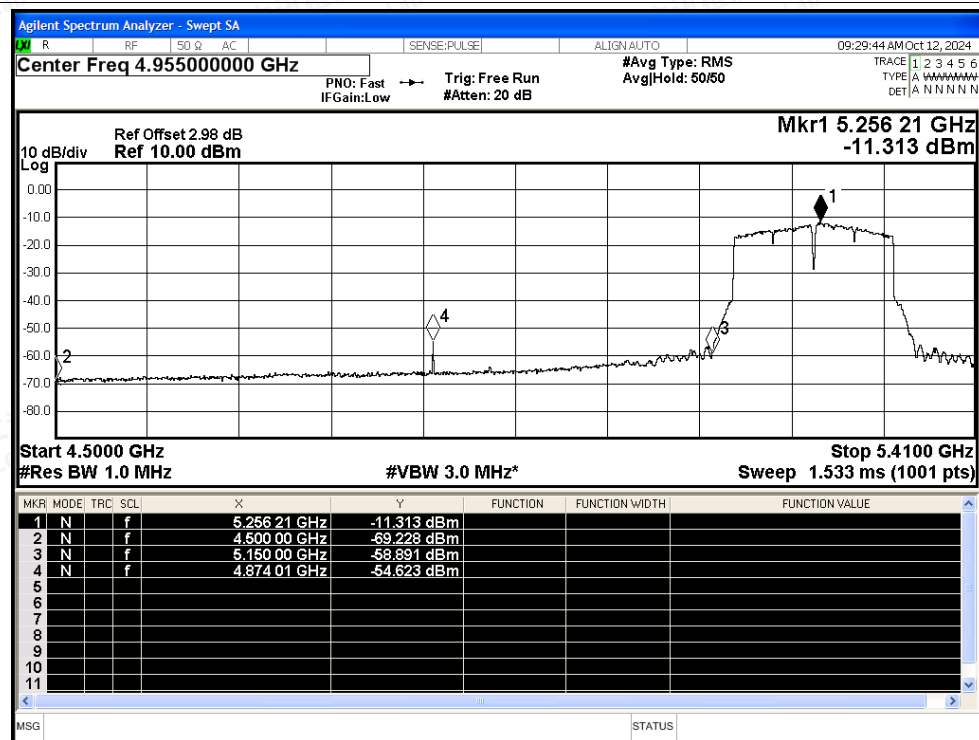

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5260MHz Ant1 Peak

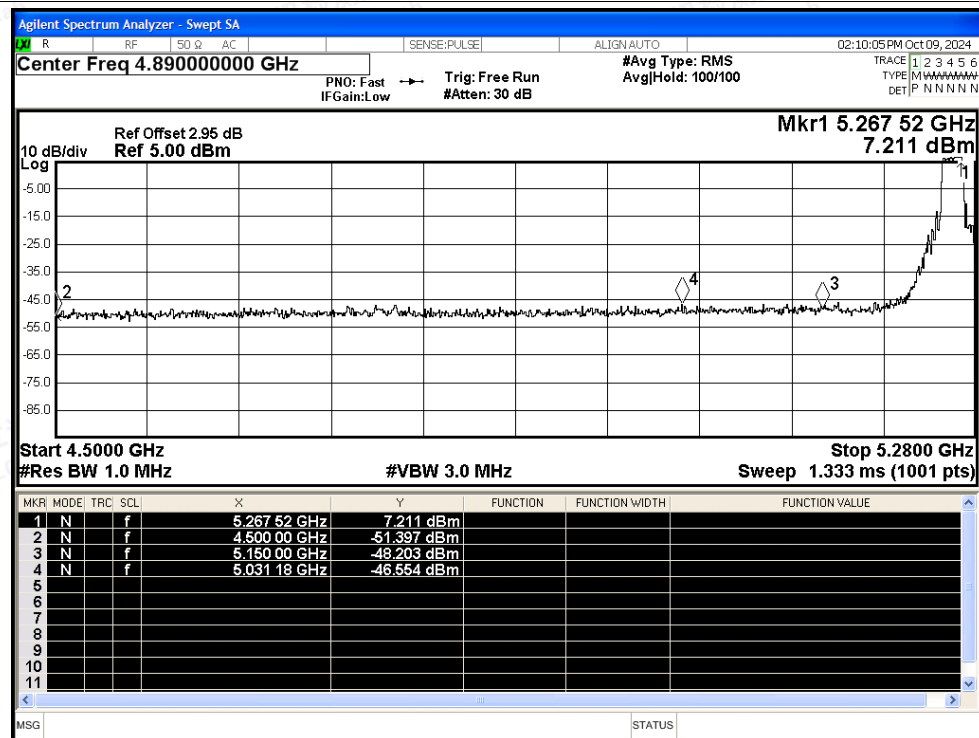

Restrict Band NVNT ax20 5260MHz Ant1 Average

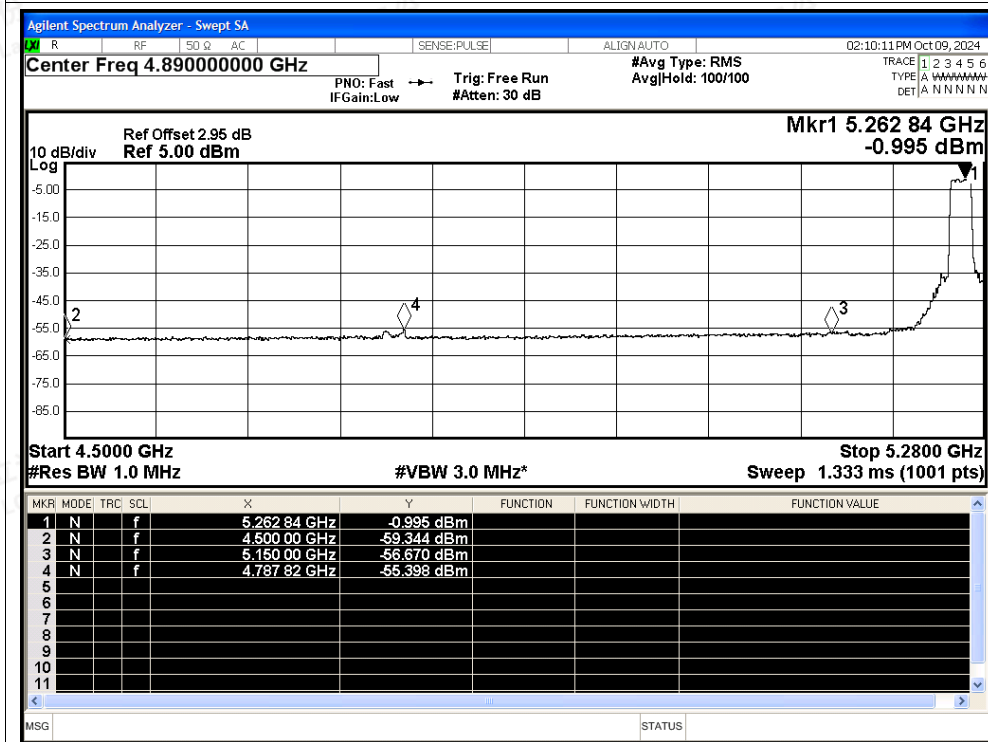

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5320MHz Ant1 Peak

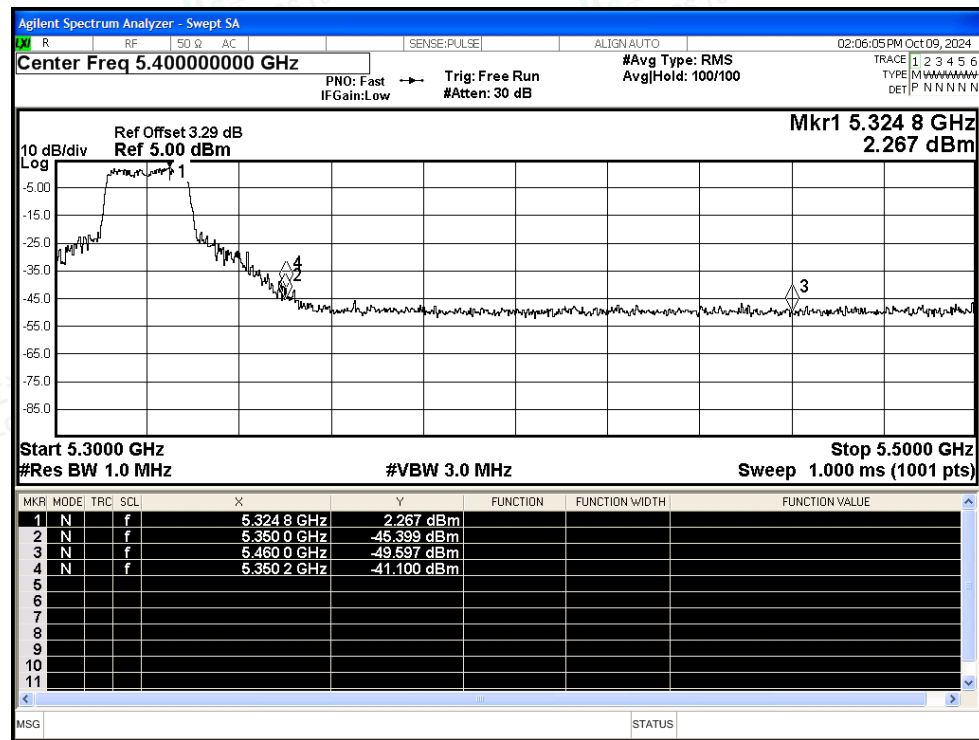


Restrict Band NVNT ax20 5320MHz Ant1 Average

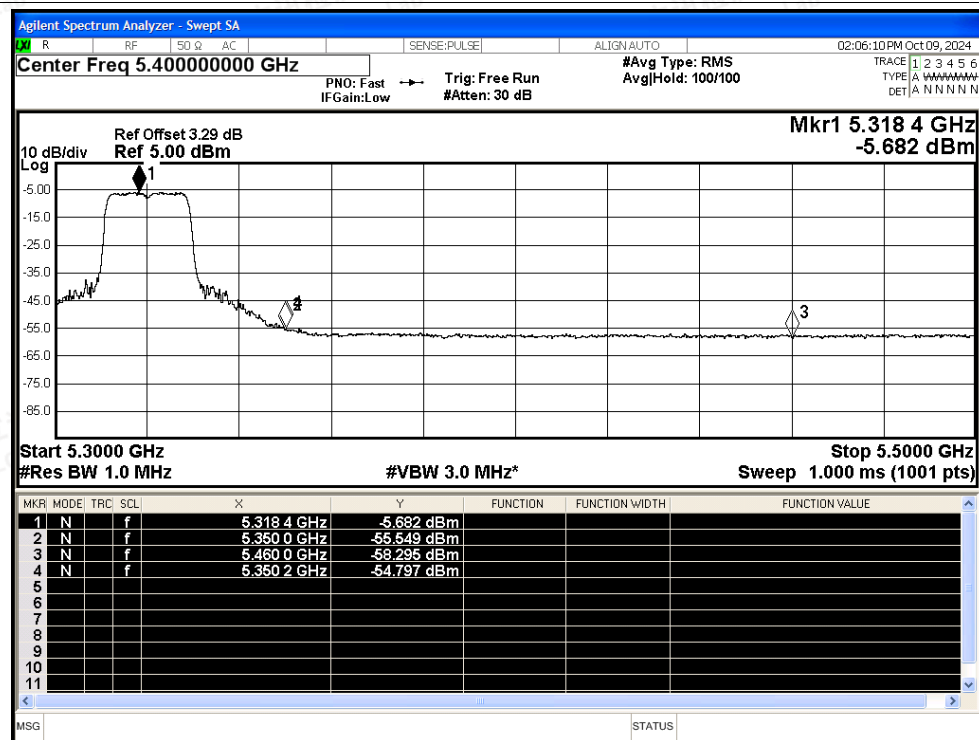




Restrict Band NVNT ax40 5270MHz Ant1 Peak

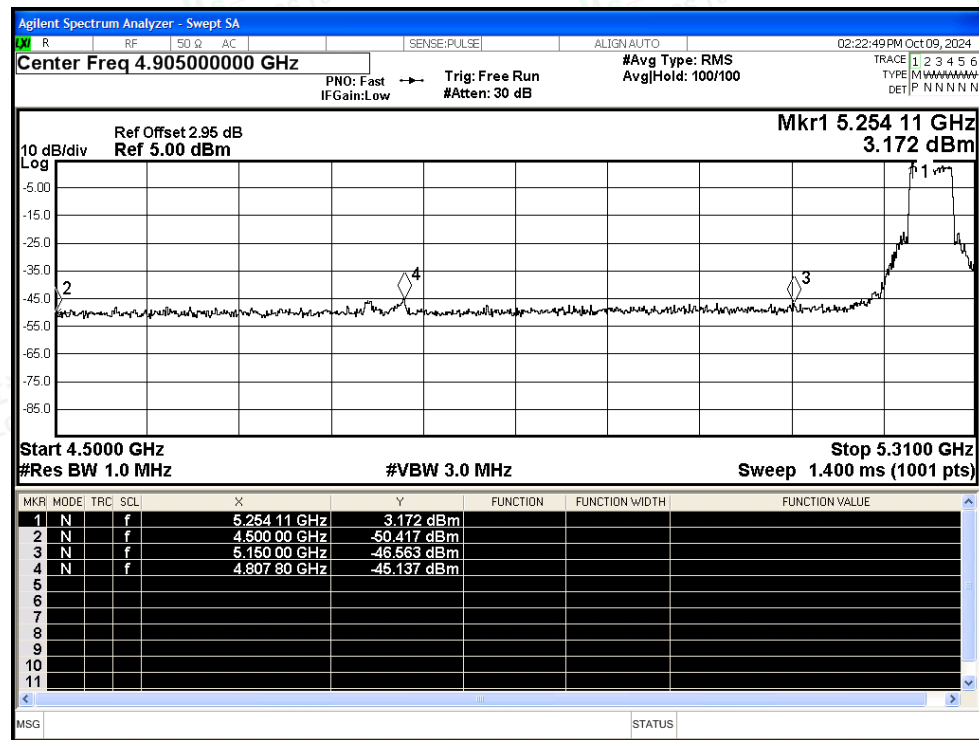

Restrict Band NVNT ax40 5270MHz Ant1 Average

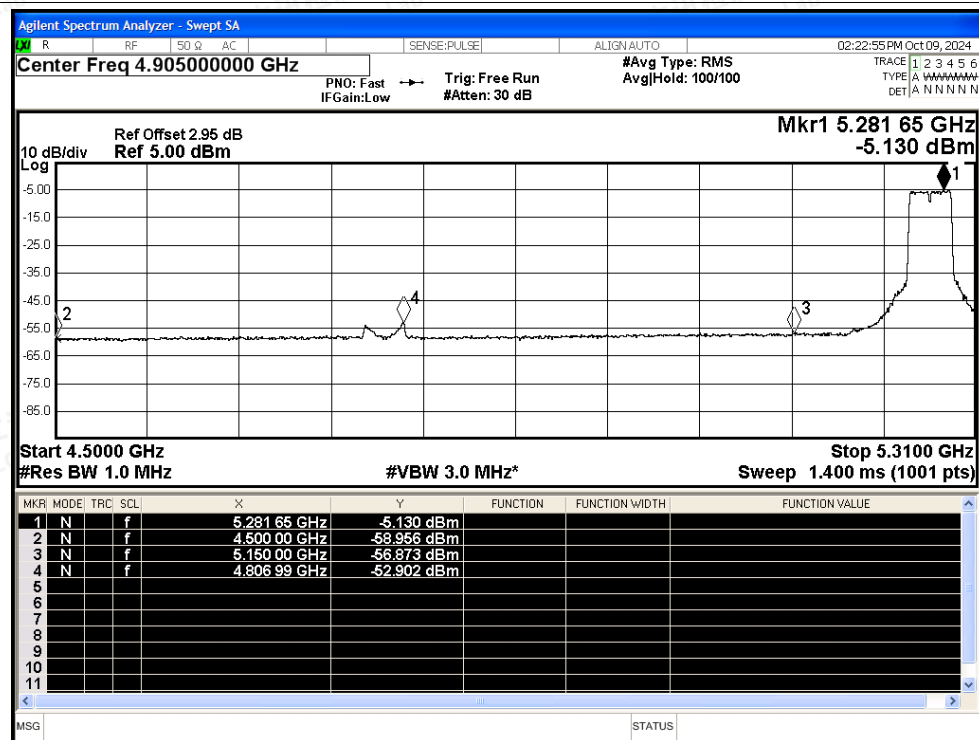

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5310MHz Ant1 Peak

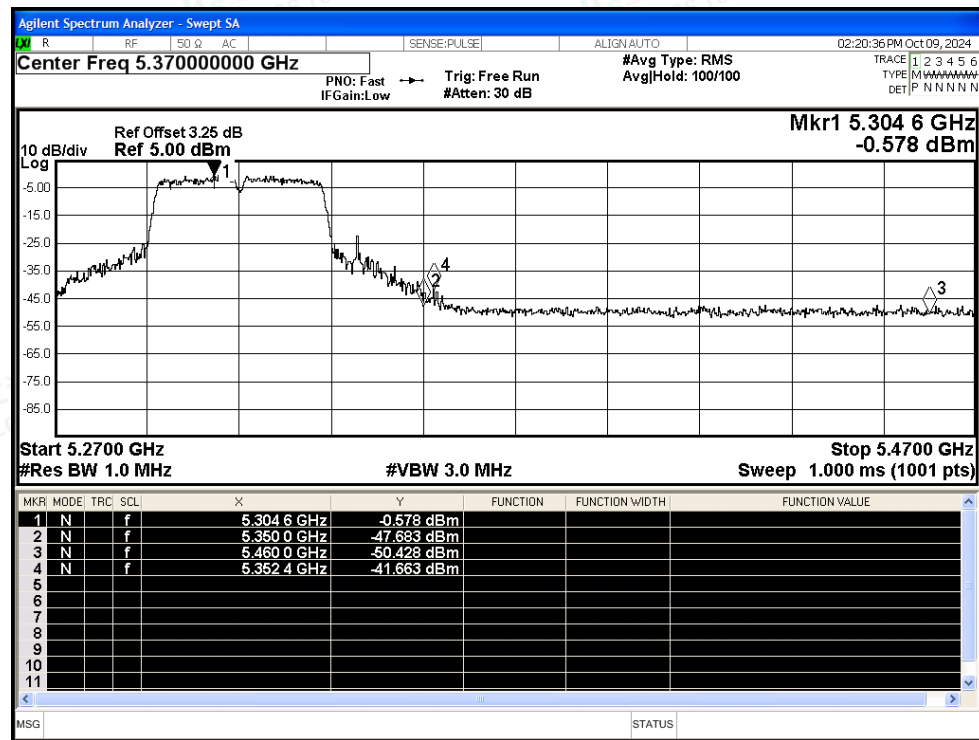

Restrict Band NVNT ax40 5310MHz Ant1 Average

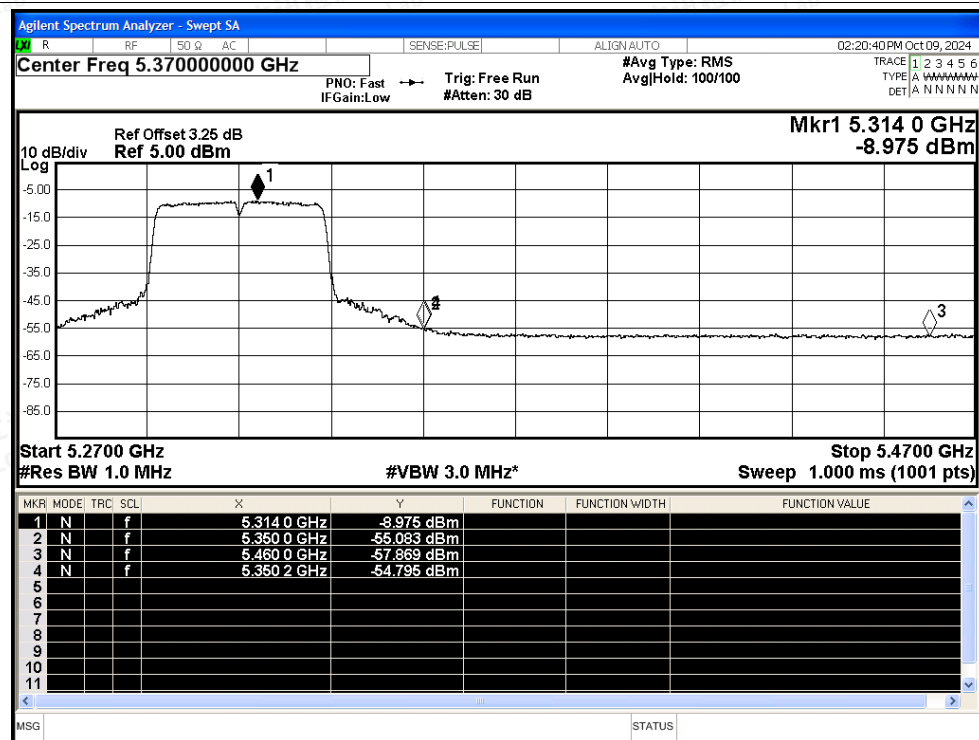

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

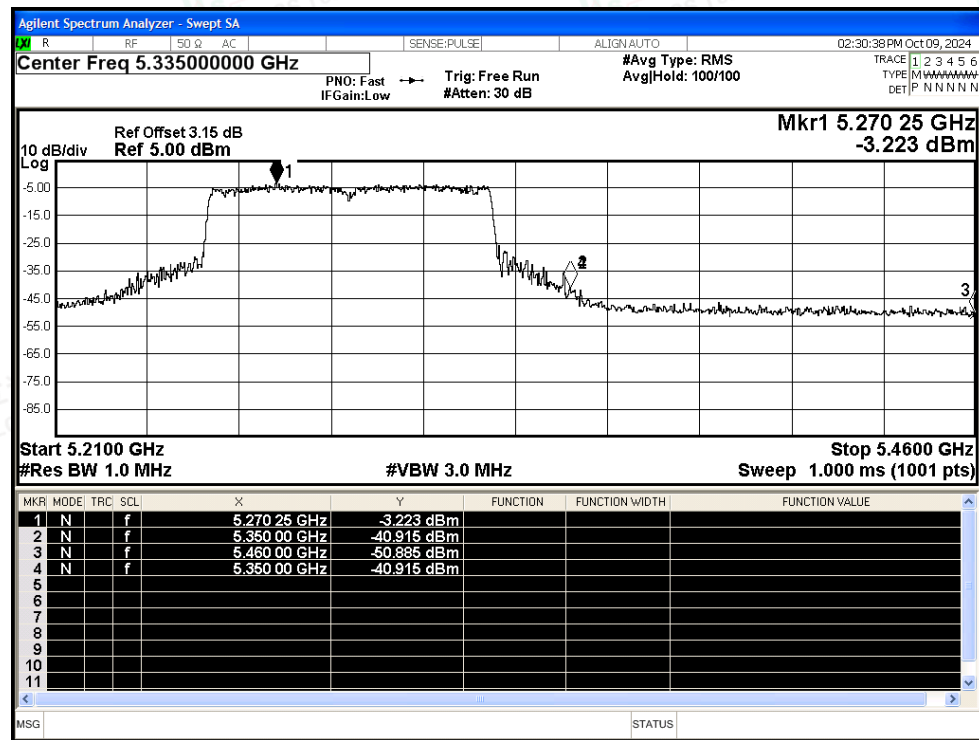

Restrict Band NVNT ax80 5290MHz Ant1 Average

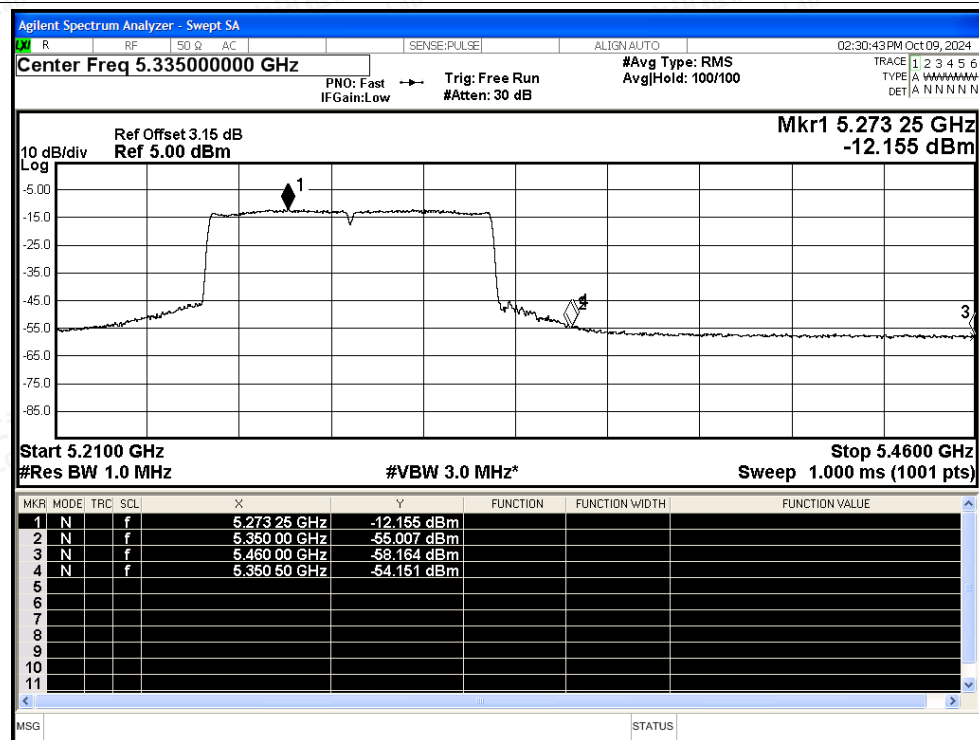

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5290MHz Ant1 Peak

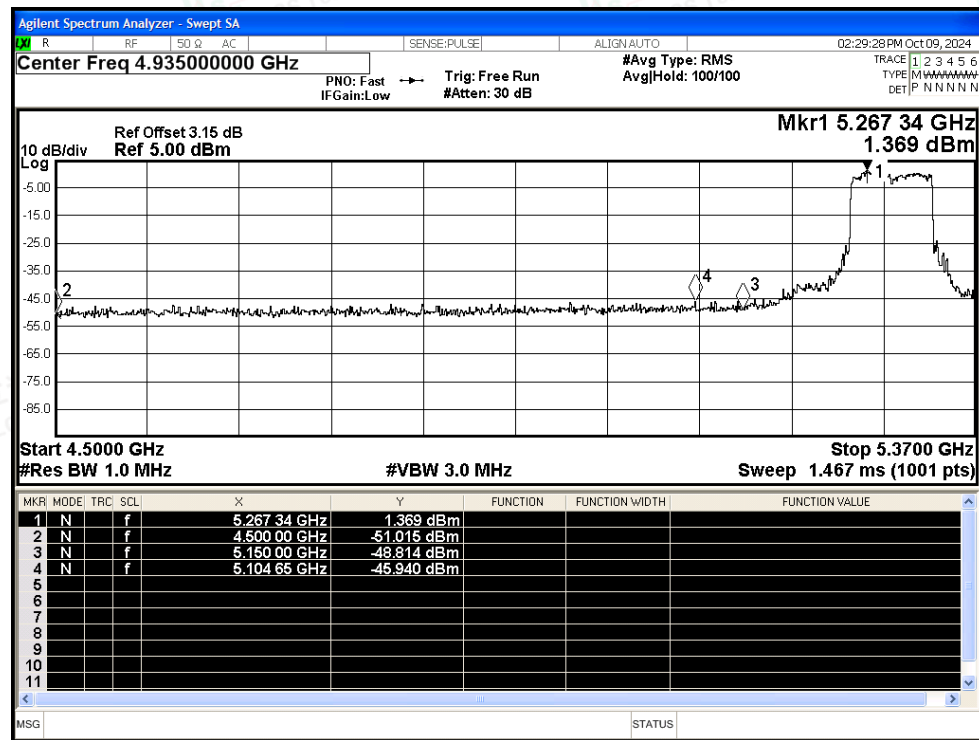

Restrict Band NVNT ax80 5290MHz Ant1 Average

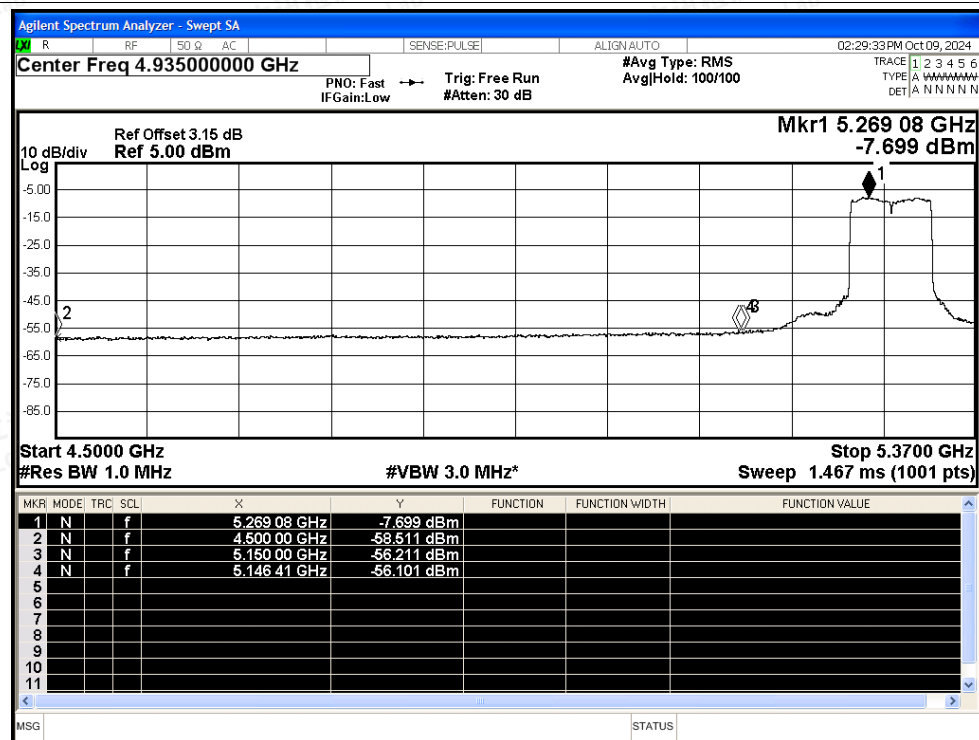

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax160 5250MHz Ant1 Peak

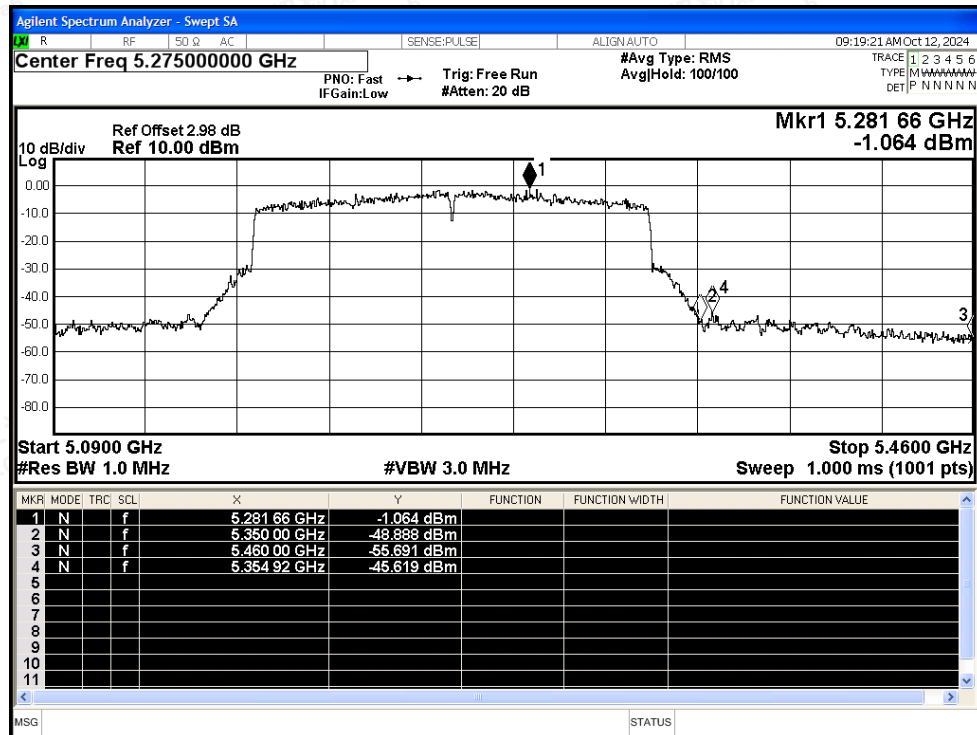

Restrict Band NVNT ax160 5250MHz Ant1 Average

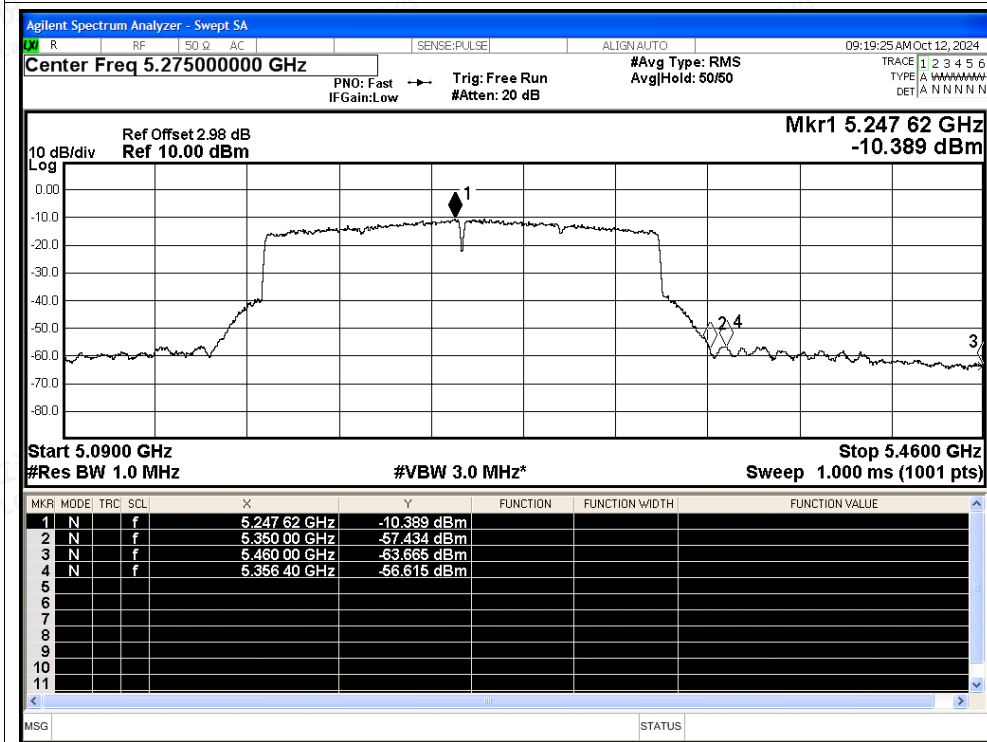

Restrict Band NVNT ax160 5250MHz Ant1 Peak




Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

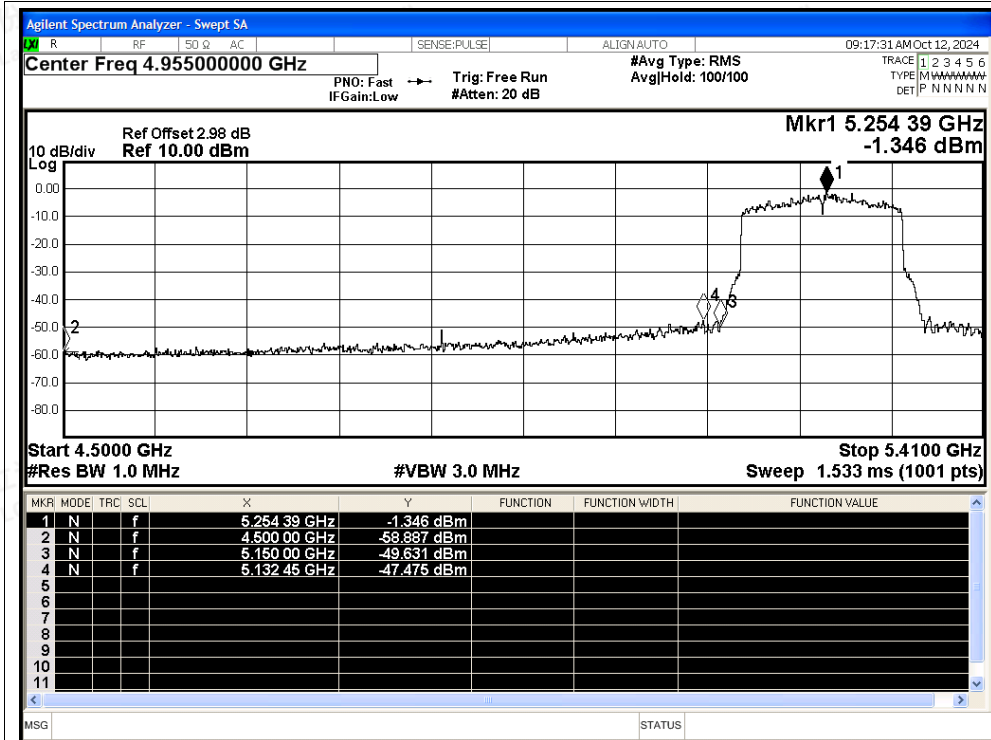

Restrict Band NVNT ax160 5250MHz Ant1 Average

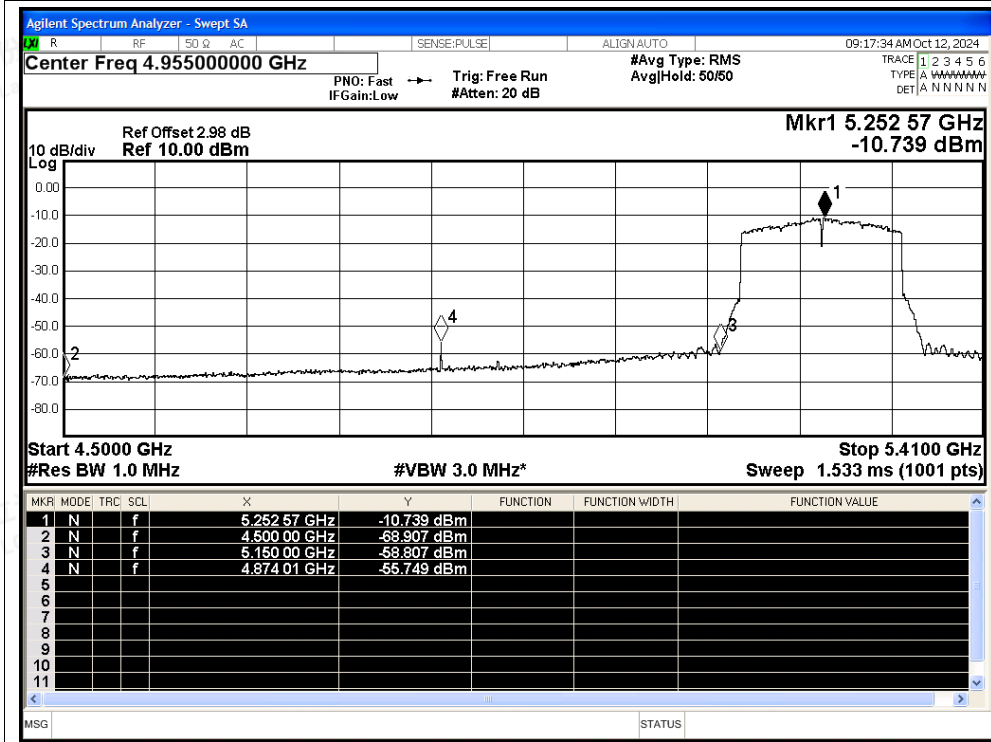

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5260	Ant2	4500	-51.26	3.09	-	47.06	Peak	68.2	Pass
NVNT	a	5260	Ant2	4500	-58.25	3.09	0.24	40.31	Average	54	Pass
NVNT	a	5260	Ant2	5077.98	-45.93	3.09	-	52.39	Peak	68.2	Pass
NVNT	a	5260	Ant2	4787.82	-55.56	3.09	0.24	43.00	Average	54	Pass
NVNT	a	5260	Ant2	5150	-48.8	3.09	-	49.52	Peak	68.2	Pass
NVNT	a	5260	Ant2	5150	-56.77	3.09	0.24	41.79	Average	54	Pass
NVNT	a	5320	Ant2	5350	-45.6	3.09	-	52.72	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350	-56.02	3.09	0.24	42.54	Average	54	Pass
NVNT	a	5320	Ant2	5350.8	-41.33	3.09	-	56.99	Peak	68.2	Pass
NVNT	a	5320	Ant2	5350.8	-55.09	3.09	0.24	43.47	Average	54	Pass
NVNT	a	5320	Ant2	5460	-49.23	3.09	-	49.09	Peak	68.2	Pass
NVNT	a	5320	Ant2	5460	-57.82	3.09	0.24	40.74	Average	54	Pass
NVNT	n20	5260	Ant2	4500	-49.14	3.09	-	49.18	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4500	-59.24	3.09	0.12	39.20	Average	54	Pass
NVNT	n20	5260	Ant2	5089.68	-47.04	3.09	-	51.28	Peak	68.2	Pass
NVNT	n20	5260	Ant2	4787.82	-56.18	3.09	0.12	42.26	Average	54	Pass
NVNT	n20	5260	Ant2	5150	-48.24	3.09	-	50.08	Peak	68.2	Pass
NVNT	n20	5260	Ant2	5150	-57.18	3.09	0.12	41.26	Average	54	Pass
NVNT	n20	5320	Ant2	5350	-44.83	3.09	-	53.49	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.34	3.09	0.12	43.10	Average	54	Pass
NVNT	n20	5320	Ant2	5350.6	-41.08	3.09	-	57.24	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5350	-55.34	3.09	0.12	43.10	Average	54	Pass
NVNT	n20	5320	Ant2	5460	-47.21	3.09	-	51.11	Peak	68.2	Pass
NVNT	n20	5320	Ant2	5460	-58.3	3.09	0.12	40.14	Average	54	Pass
NVNT	n40	5270	Ant2	4500	-50.98	3.09	-	47.34	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4500	-58.95	3.09	0.12	39.49	Average	54	Pass
NVNT	n40	5270	Ant2	4807.8	-45.38	3.09	-	52.94	Peak	68.2	Pass
NVNT	n40	5270	Ant2	4806.99	-53.72	3.09	0.12	44.72	Average	54	Pass
NVNT	n40	5270	Ant2	5150	-48.99	3.09	-	49.33	Peak	68.2	Pass
NVNT	n40	5270	Ant2	5150	-57.23	3.09	0.12	41.21	Average	54	Pass
NVNT	n40	5310	Ant2	5350	-40.07	3.09	-	58.25	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350	-52.33	3.09	0.12	46.11	Average	54	Pass
NVNT	n40	5310	Ant2	5350.2	-37.07	3.09	-	61.25	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5350.2	-51.87	3.09	0.12	46.57	Average	54	Pass
NVNT	n40	5310	Ant2	5460	-50.06	3.09	-	48.26	Peak	68.2	Pass
NVNT	n40	5310	Ant2	5460	-57.77	3.09	0.12	40.67	Average	54	Pass
NVNT	ac20	5260	Ant2	4500	-51.89	3.09	-	46.43	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	4500	-59	3.09	0.12	39.44	Average	54	Pass
NVNT	ac20	5260	Ant2	4958.64	-46.71	3.09	-	51.61	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac20	5260	Ant2	4787.82	-55.79	3.09	0.12	42.65	Average	54	Pass
NVNT	ac20	5260	Ant2	5150	-48.22	3.09	-	50.10	Peak	68.2	Pass
NVNT	ac20	5260	Ant2	5150	-56.95	3.09	0.12	41.49	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-39.35	3.09	-	58.97	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-54.52	3.09	0.12	43.92	Average	54	Pass
NVNT	ac20	5320	Ant2	5350	-39.35	3.09	-	58.97	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5350	-54.52	3.09	0.12	43.92	Average	54	Pass
NVNT	ac20	5320	Ant2	5460	-50.24	3.09	-	48.08	Peak	68.2	Pass
NVNT	ac20	5320	Ant2	5460	-57.6	3.09	0.12	40.84	Average	54	Pass
NVNT	ac40	5270	Ant2	4500	-49.14	3.09	-	49.18	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4500	-58.93	3.09	0.12	39.51	Average	54	Pass
NVNT	ac40	5270	Ant2	4806.18	-44.83	3.09	-	53.49	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	4806.18	-53.71	3.09	0.12	44.73	Average	54	Pass
NVNT	ac40	5270	Ant2	5150	-49.2	3.09	-	49.12	Peak	68.2	Pass
NVNT	ac40	5270	Ant2	5150	-57.35	3.09	0.12	41.09	Average	54	Pass
NVNT	ac40	5310	Ant2	5350	-40.21	3.09	-	58.11	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350	-51.97	3.09	0.12	46.47	Average	54	Pass
NVNT	ac40	5310	Ant2	5350.8	-36.4	3.09	-	61.92	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5350.6	-51.43	3.09	0.12	47.01	Average	54	Pass
NVNT	ac40	5310	Ant2	5460	-49.92	3.09	-	48.40	Peak	68.2	Pass
NVNT	ac40	5310	Ant2	5460	-57.49	3.09	0.12	40.95	Average	54	Pass
NVNT	ac80	5290	Ant2	4500	-49.69	3.09	-	48.63	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	4500	-58.85	3.09	0.25	39.72	Average	54	Pass
NVNT	ac80	5290	Ant2	5007.21	-46.55	3.09	-	51.77	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5146.41	-56.51	3.09	0.25	42.06	Average	54	Pass
NVNT	ac80	5290	Ant2	5150	-48.81	3.09	-	49.51	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5150	-57.36	3.09	0.25	41.21	Average	54	Pass
NVNT	ac80	5290	Ant2	5350	-42.77	3.09	-	55.55	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350	-53.77	3.09	0.25	44.80	Average	54	Pass
NVNT	ac80	5290	Ant2	5352.5	-38.65	3.09	-	59.67	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5350.5	-53.07	3.09	0.25	45.50	Average	54	Pass
NVNT	ac80	5290	Ant2	5460	-50.05	3.09	-	48.27	Peak	68.2	Pass
NVNT	ac80	5290	Ant2	5460	-57.83	3.09	0.25	40.74	Average	54	Pass
NVNT	ac160	5250	Ant2	5350	-50.42	3.09	-	47.9	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5350	-57.78	3.09	0.4	40.94	Average	54	Pass
NVNT	ac160	5250	Ant2	5356.03	-48.6	3.09	-	49.72	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5354.55	-57.2	3.09	0.4	41.52	Average	54	Pass
NVNT	ac160	5250	Ant2	5460	-56.95	3.09	-	41.37	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5460	-65.88	3.09	0.4	32.84	Average	54	Pass
NVNT	ac160	5250	Ant2	4500	-58.89	3.09	-	39.43	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	4500	-68.65	3.09	0.4	30.07	Average	54	Pass
NVNT	ac160	5250	Ant2	5146.1	-47.78	3.09	-	50.54	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac160	5250	Ant2	5144.28	-57.42	3.09	0.4	41.3	Average	54	Pass
NVNT	ac160	5250	Ant2	5150	-54.47	3.09	-	43.85	Peak	68.2	Pass
NVNT	ac160	5250	Ant2	5150	-60.52	3.09	0.4	38.2	Average	54	Pass
NVNT	ax20	5260	Ant2	4500	-50.3	3.09	-	48.02	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4500	-58.43	3.09	0.12	40.01	Average	54	Pass
NVNT	ax20	5260	Ant2	4979.7	-46.6	3.09	-	51.72	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	4772.22	-56	3.09	0.12	42.44	Average	54	Pass
NVNT	ax20	5260	Ant2	5150	-49.37	3.09	-	48.95	Peak	68.2	Pass
NVNT	ax20	5260	Ant2	5150	-57.25	3.09	0.12	41.19	Average	54	Pass
NVNT	ax20	5320	Ant2	5350	-42.12	3.09	-	56.20	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350	-54.9	3.09	0.12	43.54	Average	54	Pass
NVNT	ax20	5320	Ant2	5351	-41.57	3.09	-	56.75	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5350.2	-54.75	3.09	0.12	43.69	Average	54	Pass
NVNT	ax20	5320	Ant2	5460	-49.61	3.09	-	48.71	Peak	68.2	Pass
NVNT	ax20	5320	Ant2	5460	-57.97	3.09	0.12	40.47	Average	54	Pass
NVNT	ax40	5270	Ant2	4500	-50.45	3.09	-	47.87	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4500	-59.33	3.09	0.12	39.11	Average	54	Pass
NVNT	ax40	5270	Ant2	4807.8	-45.22	3.09	-	53.10	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	4806.99	-53.66	3.09	0.12	44.78	Average	54	Pass
NVNT	ax40	5270	Ant2	5150	-48.81	3.09	-	49.51	Peak	68.2	Pass
NVNT	ax40	5270	Ant2	5150	-56.87	3.09	0.12	41.57	Average	54	Pass
NVNT	ax40	5310	Ant2	5350	-42.39	3.09	-	55.93	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-54.44	3.09	0.12	44.00	Average	54	Pass
NVNT	ax40	5310	Ant2	5353.8	-41.62	3.09	-	56.70	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5350	-54.44	3.09	0.12	44.00	Average	54	
NVNT	ax40	5310	Ant2	5460	-50.3	3.09	-	48.02	Peak	68.2	Pass
NVNT	ax40	5310	Ant2	5460	-58.07	3.09	0.12	40.37	Average	54	Pass
NVNT	ax80	5290	Ant2	5350	-47.14	3.09	-	51.18	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-53.47	3.09	0.25	45.10	Average	54	Pass
NVNT	ax80	5290	Ant2	5358	-42.98	3.09	-	55.34	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5350	-53.47	3.09	0.25	45.10	Average	54	Pass
NVNT	ax80	5290	Ant2	5460	-50.24	3.09	-	48.08	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5460	-58.13	3.09	0.25	40.44	Average	54	Pass
NVNT	ax80	5290	Ant2	4500	-49.95	3.09	-	48.37	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	4500	-58.8	3.09	0.25	39.77	Average	54	Pass
NVNT	ax80	5290	Ant2	5115.96	-46.36	3.09	-	51.96	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5022	-56.57	3.09	0.25	42.00	Average	54	Pass
NVNT	ax80	5290	Ant2	5150	-48.16	3.09	-	50.16	Peak	68.2	Pass
NVNT	ax80	5290	Ant2	5150	-57.54	3.09	0.25	41.03	Average	54	Pass
NVNT	ax160	5250	Ant2	5350	-51.32	3.09	-	47	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5350	-59.9	3.09	0.5	38.92	Average	54	Pass
NVNT	ax160	5250	Ant2	5362.32	-49.1	3.09	-	49.22	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




NVNT	ax160	5250	Ant2	5371.57	-57.98	3.09	0.5	40.84	Average	54	Pass
NVNT	ax160	5250	Ant2	5460	-57.86	3.09	-	40.46	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5460	-65.62	3.09	0.5	33.2	Average	54	Pass
NVNT	ax160	5250	Ant2	4500	-61.19	3.09	-	37.13	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	4500	-68.39	3.09	0.5	30.43	Average	54	Pass
NVNT	ax160	5250	Ant2	5146.1	-49.36	3.09	-	48.96	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5128.81	-58.94	3.09	0.5	39.88	Average	54	Pass
NVNT	ax160	5250	Ant2	5150	-53.61	3.09	-	44.71	Peak	68.2	Pass
NVNT	ax160	5250	Ant2	5150	-61.45	3.09	0.5	37.37	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5260MHz Ant2 Peak

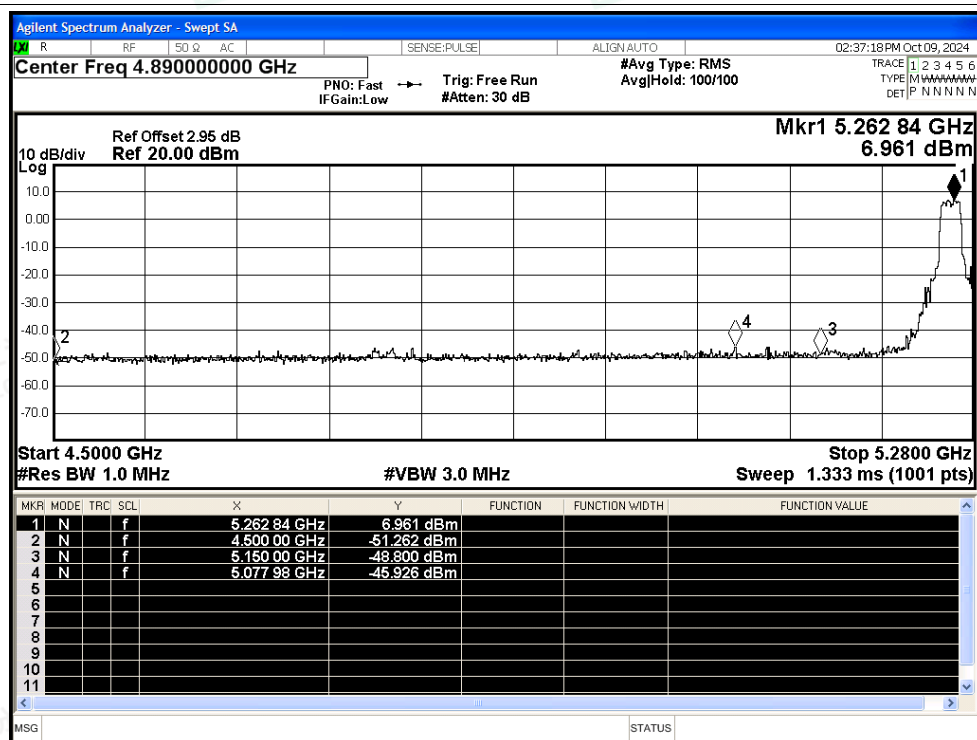

Restrict Band NVNT a 5260MHz Ant2 Average

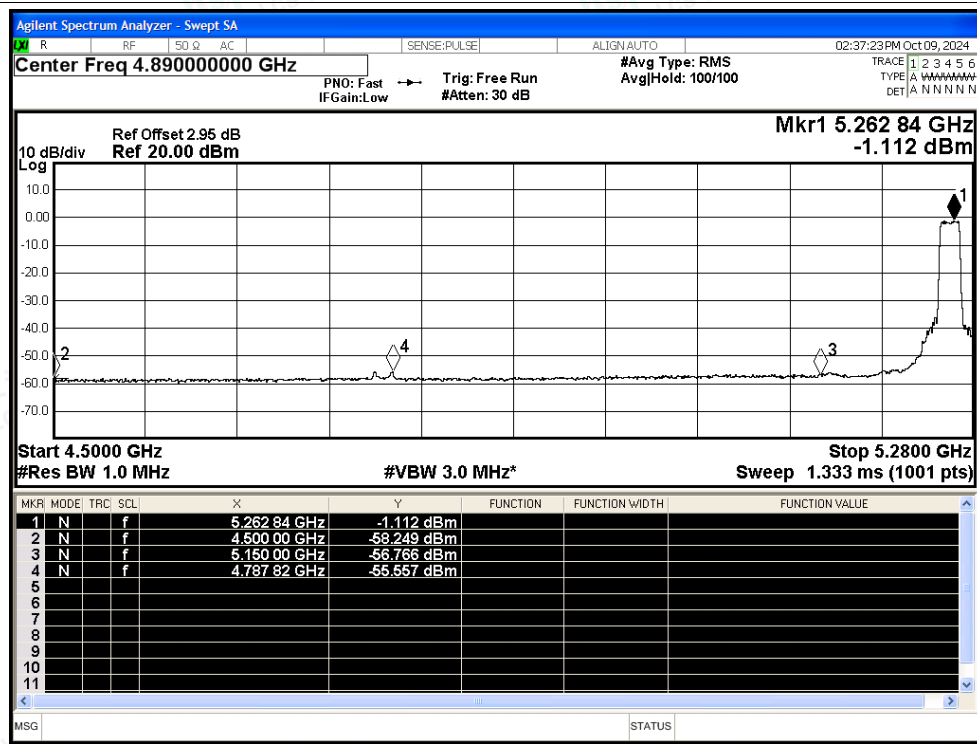

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity