





Restrict Band NVNT n40 5670MHz Ant1 Peak

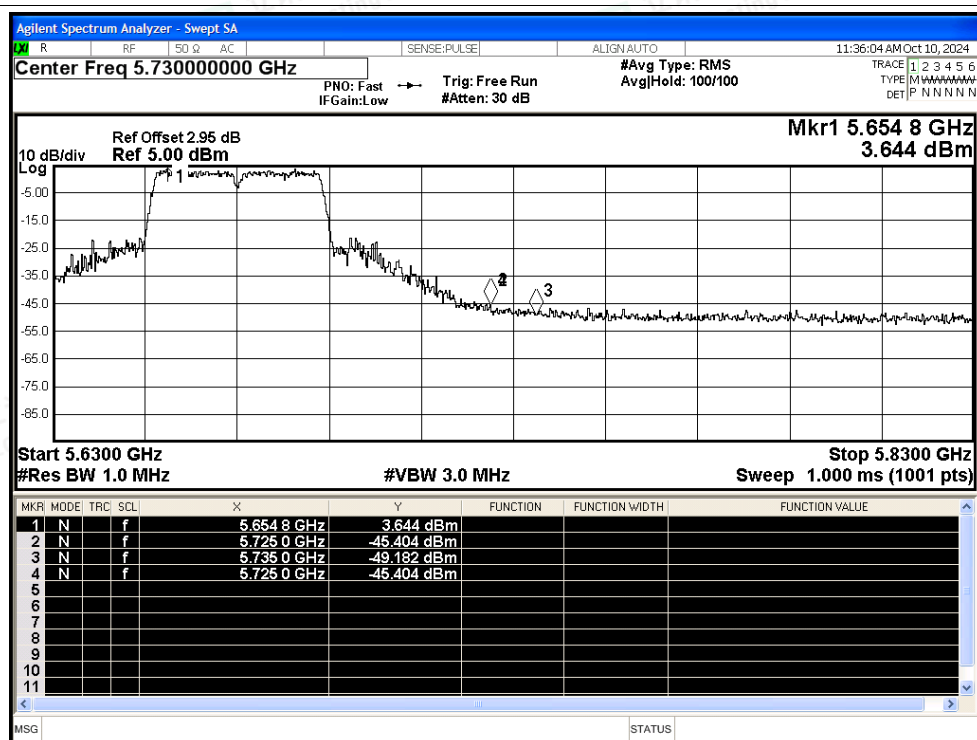


Restrict Band NVNT n40 5670MHz Ant1 Average

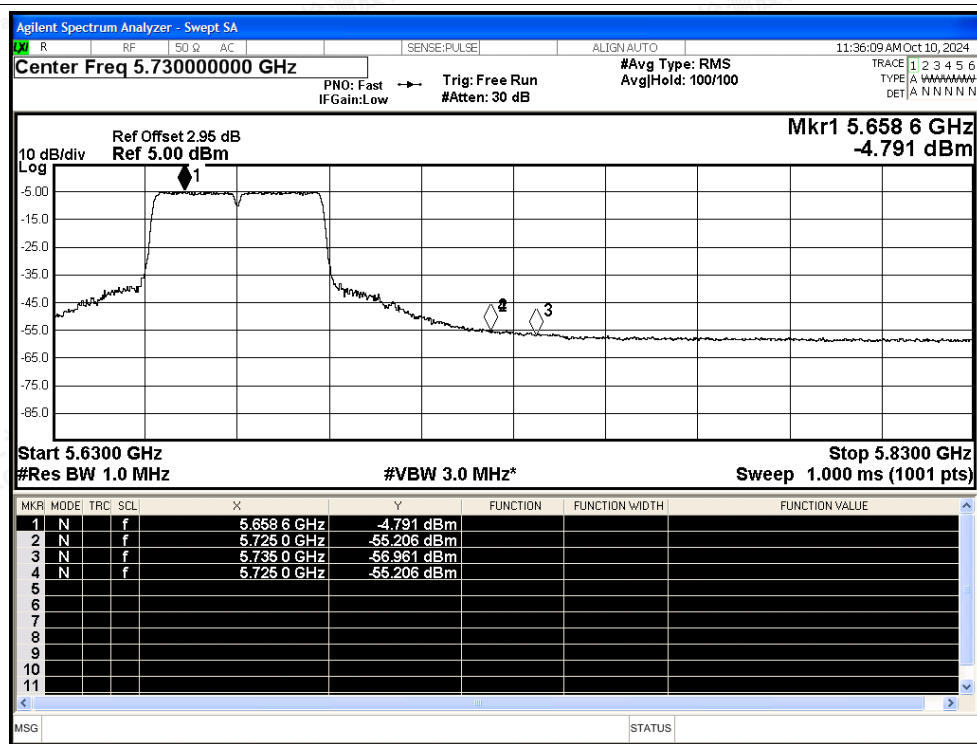




Restrict Band NVNT ac20 5500MHz Ant1 Peak

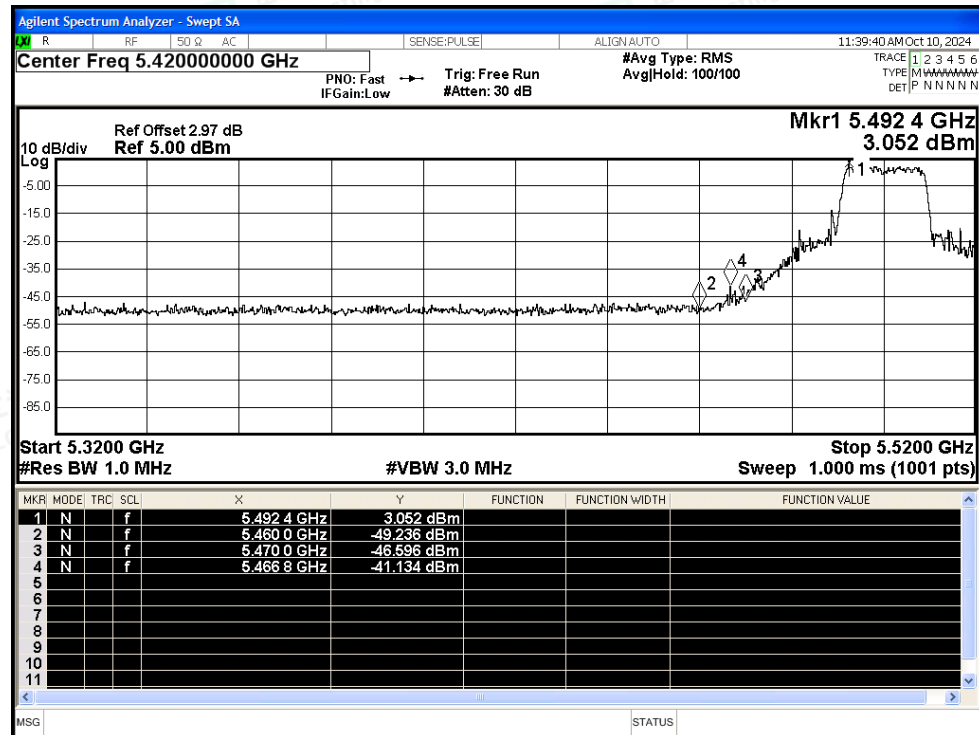


Restrict Band NVNT ac20 5500MHz Ant1 Average

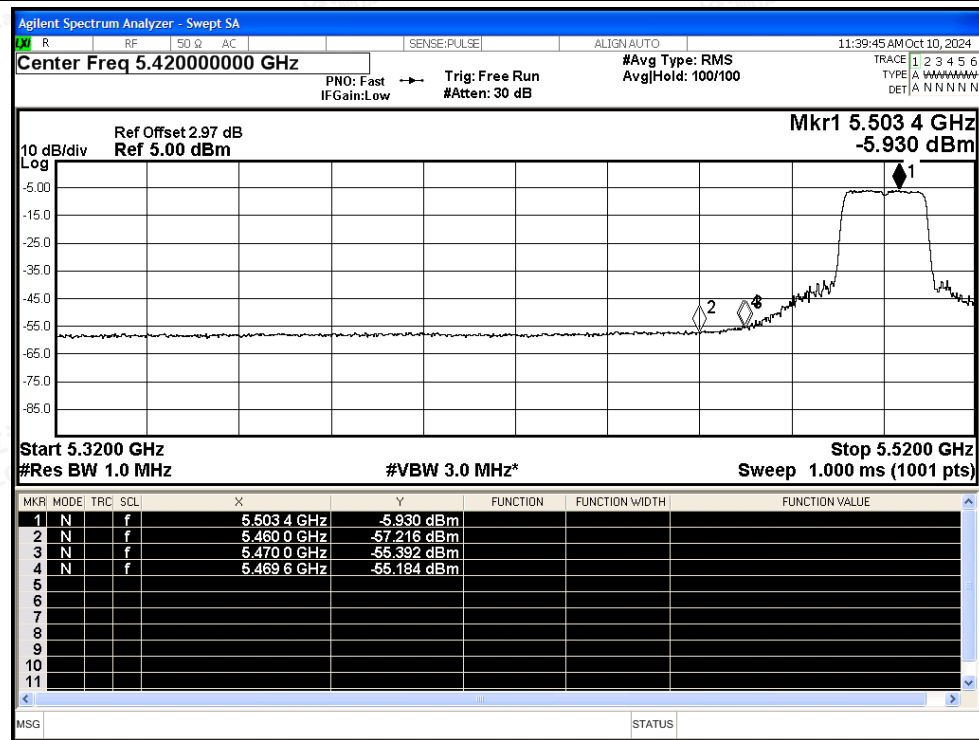




Restrict Band NVNT ac20 5700MHz Ant1 Peak

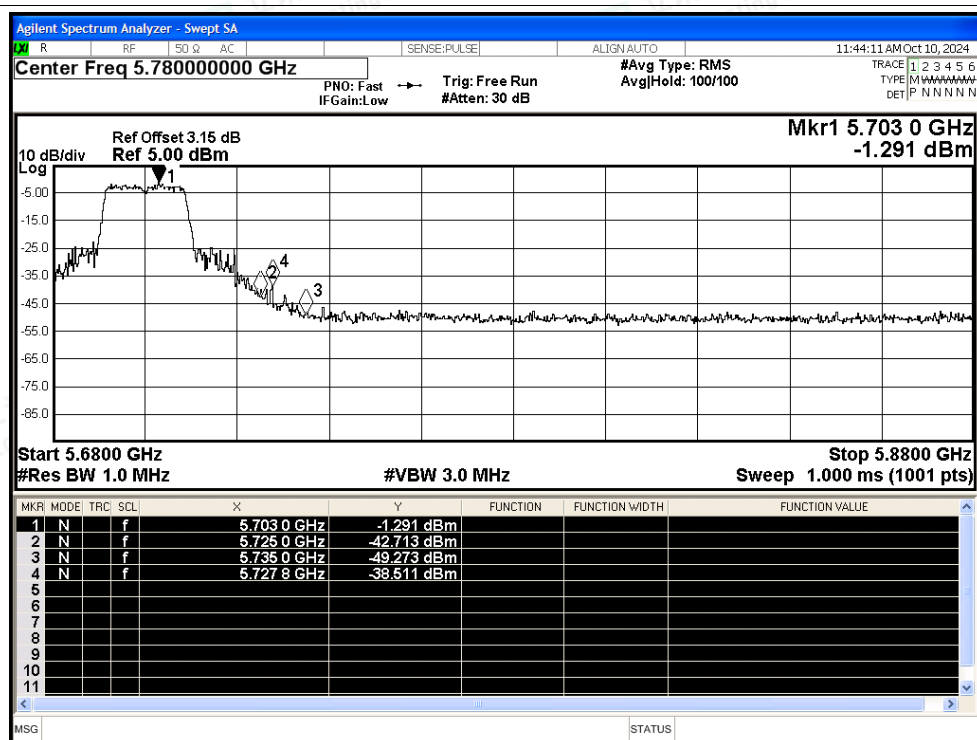

Restrict Band NVNT ac20 5700MHz Ant1 Average

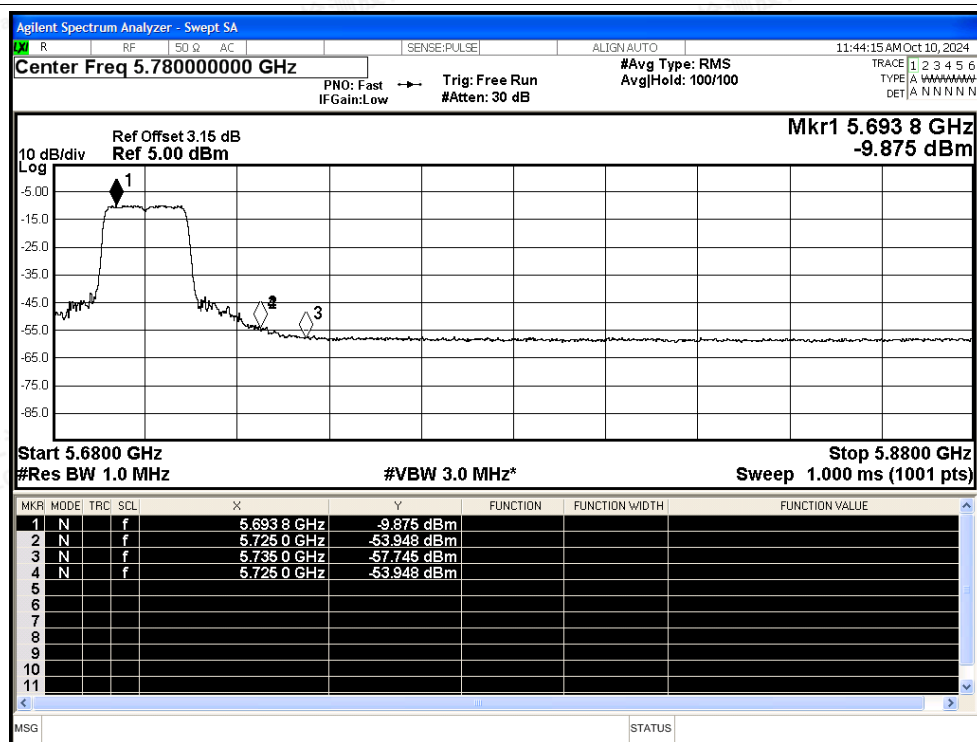




Restrict Band NVNT ac40 5510MHz Ant1 Peak




Restrict Band NVNT ac40 5510MHz Ant1 Average

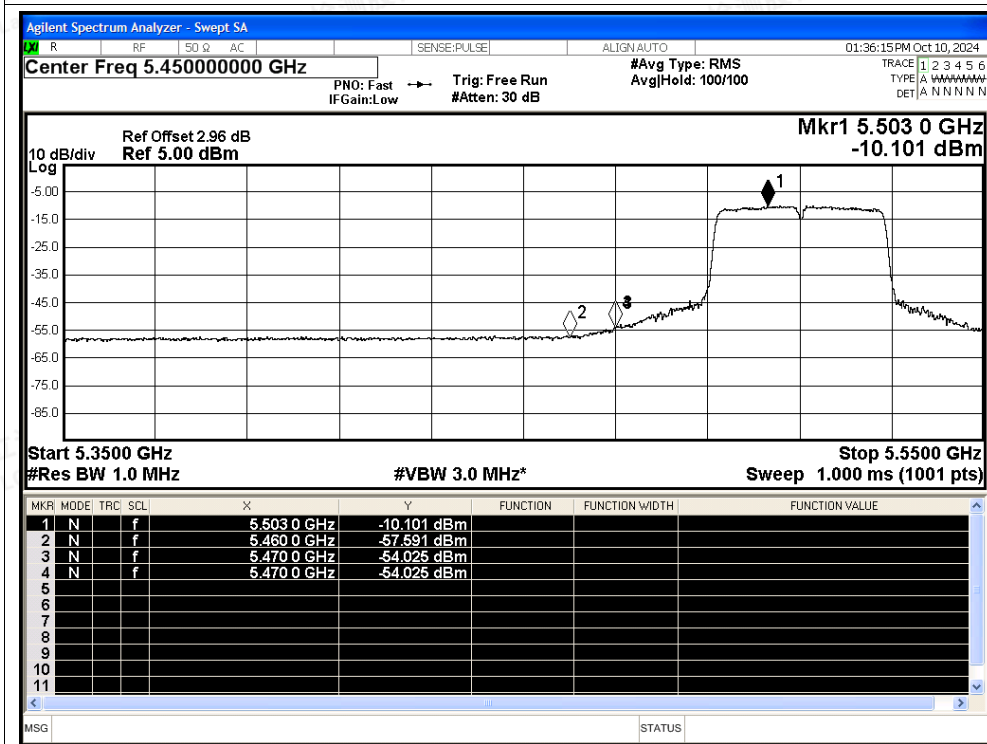




Restrict Band NVNT ac40 5670MHz Ant1 Peak

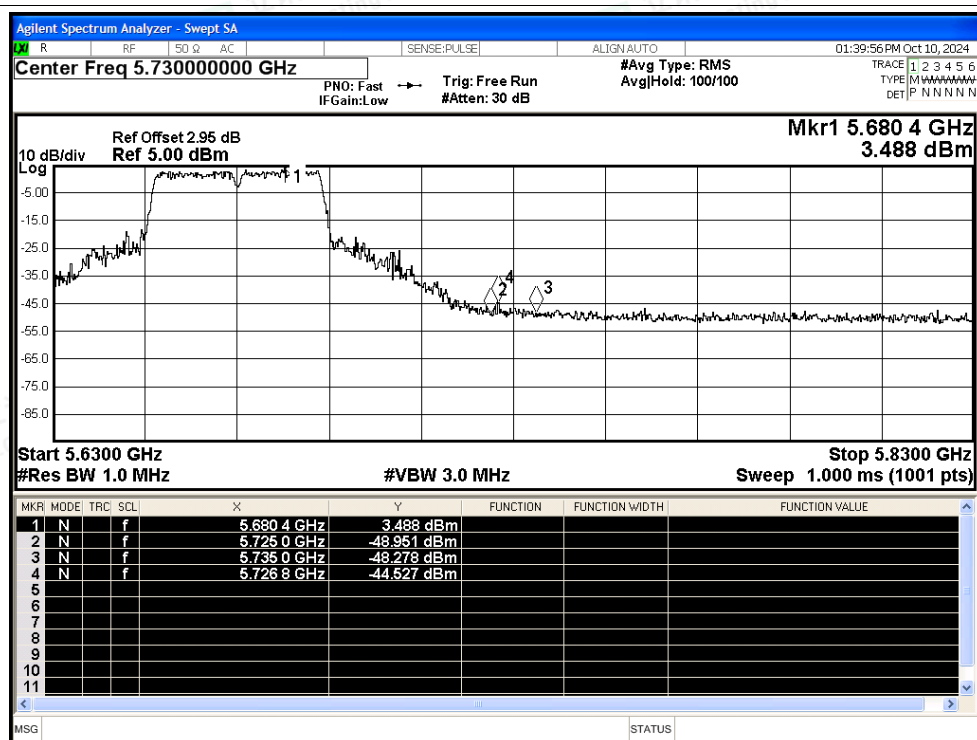


Restrict Band NVNT ac40 5670MHz Ant1 Average

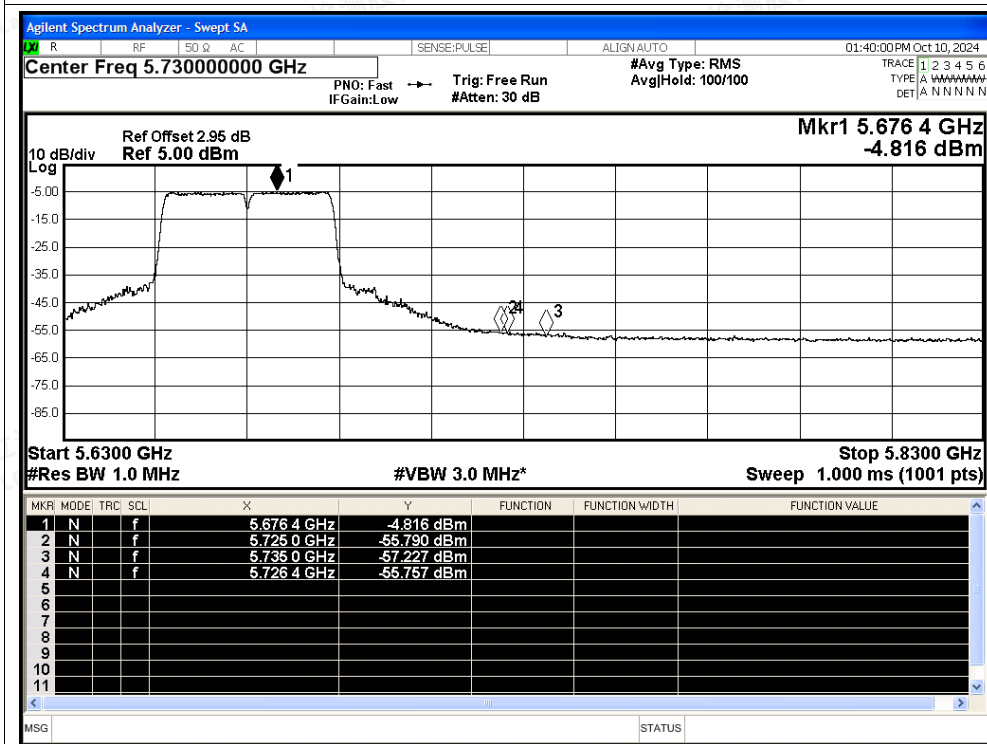




Restrict Band NVNT ac80 5530MHz Ant1 Peak

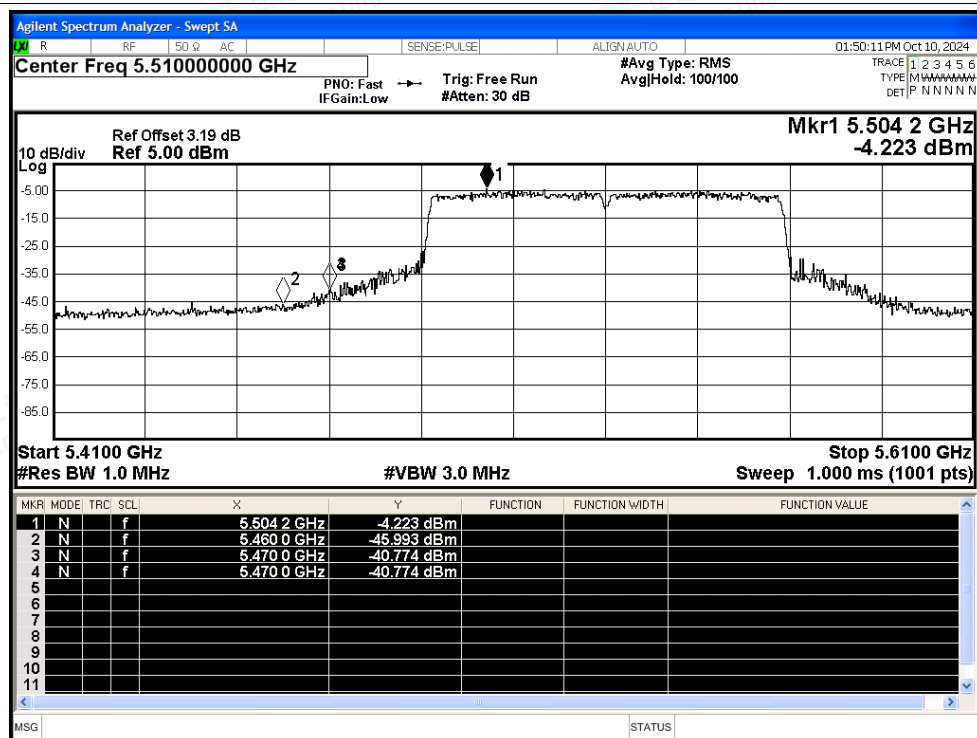


Restrict Band NVNT ac80 5530MHz Ant1 Average

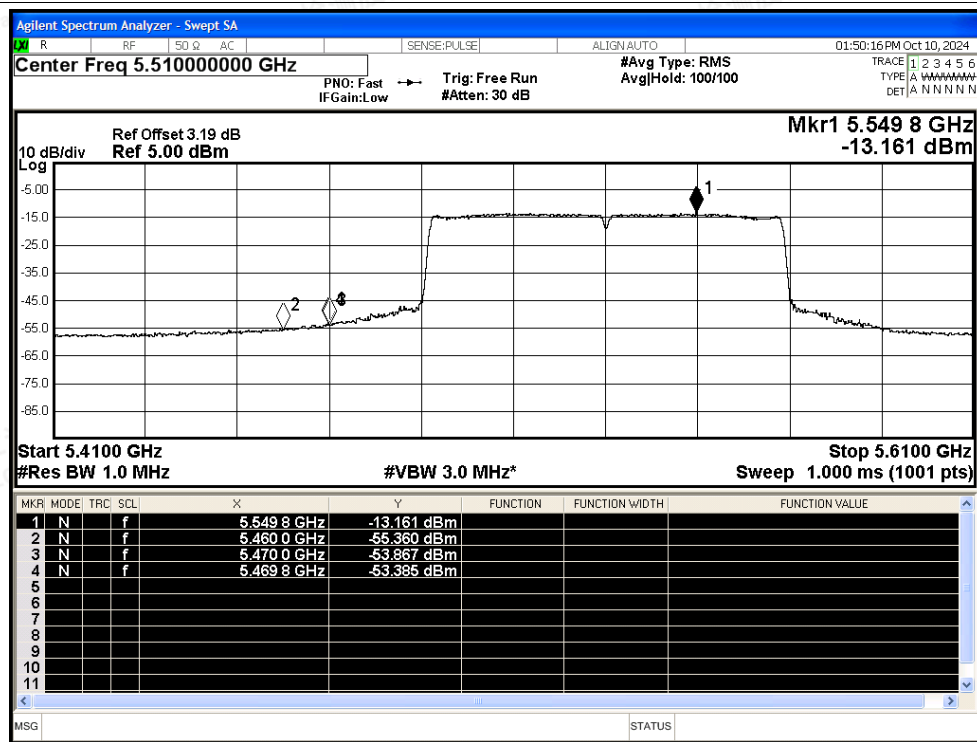




Restrict Band NVNT ac80 5610MHz Ant1 Peak

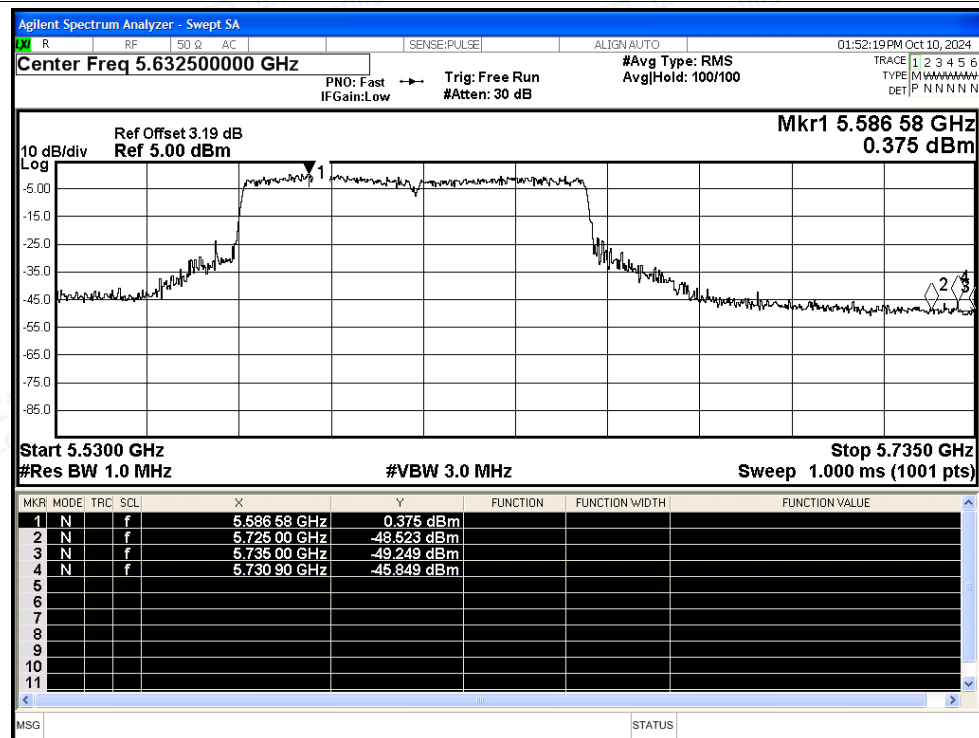


Restrict Band NVNT ac80 5610MHz Ant1 Average

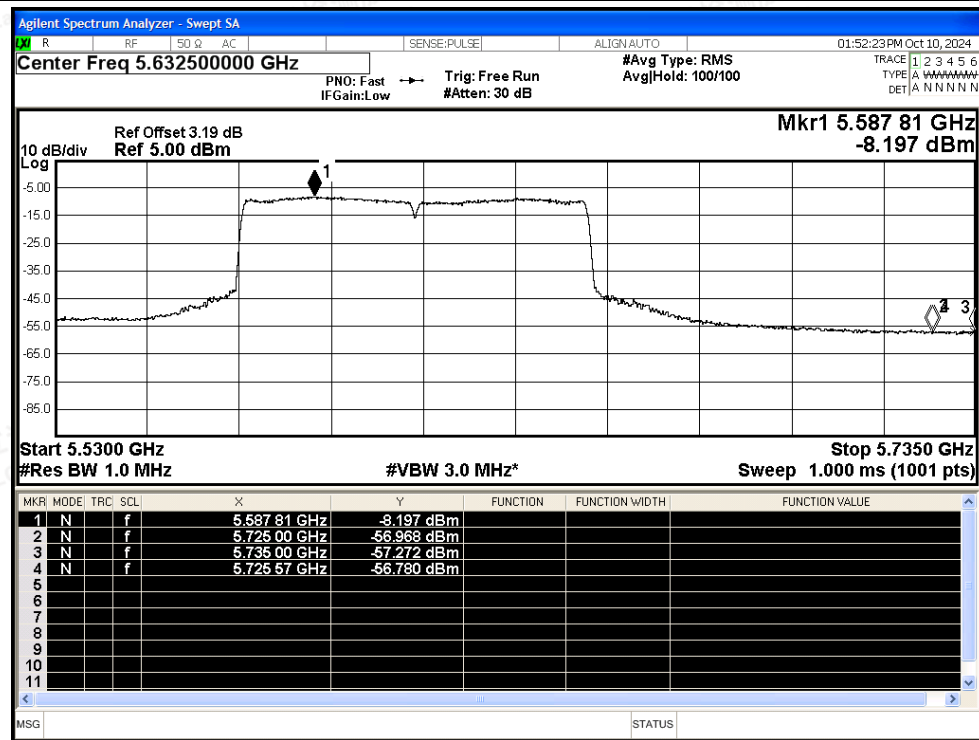




Restrict Band NVNT ac160 5570MHz Ant1 Peak

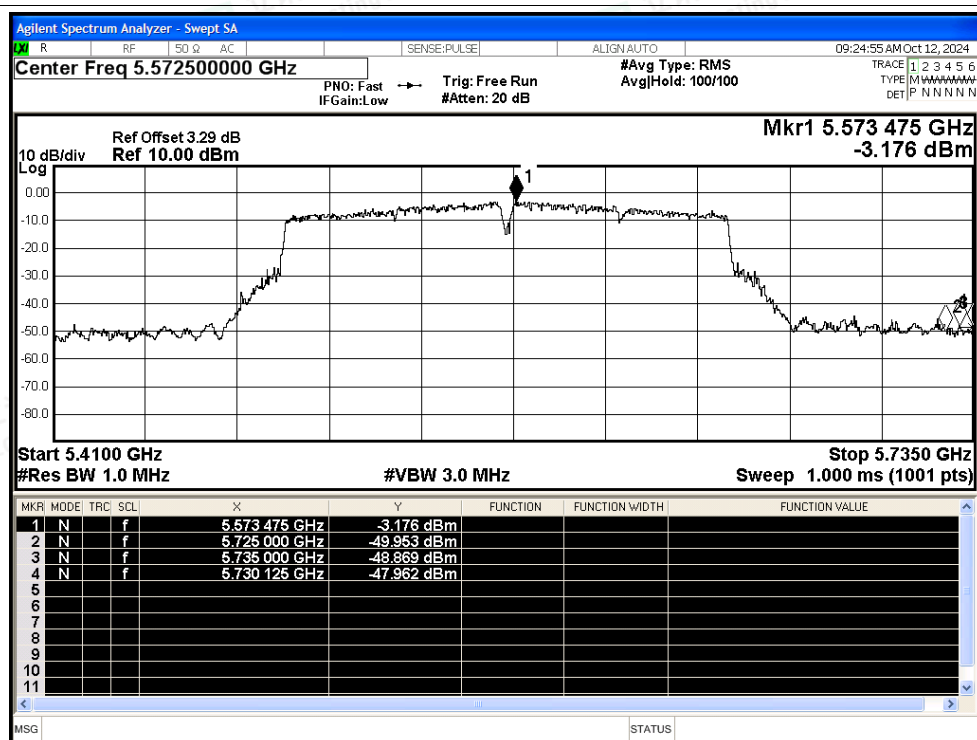


Restrict Band NVNT ac160 5570MHz Ant1 Average

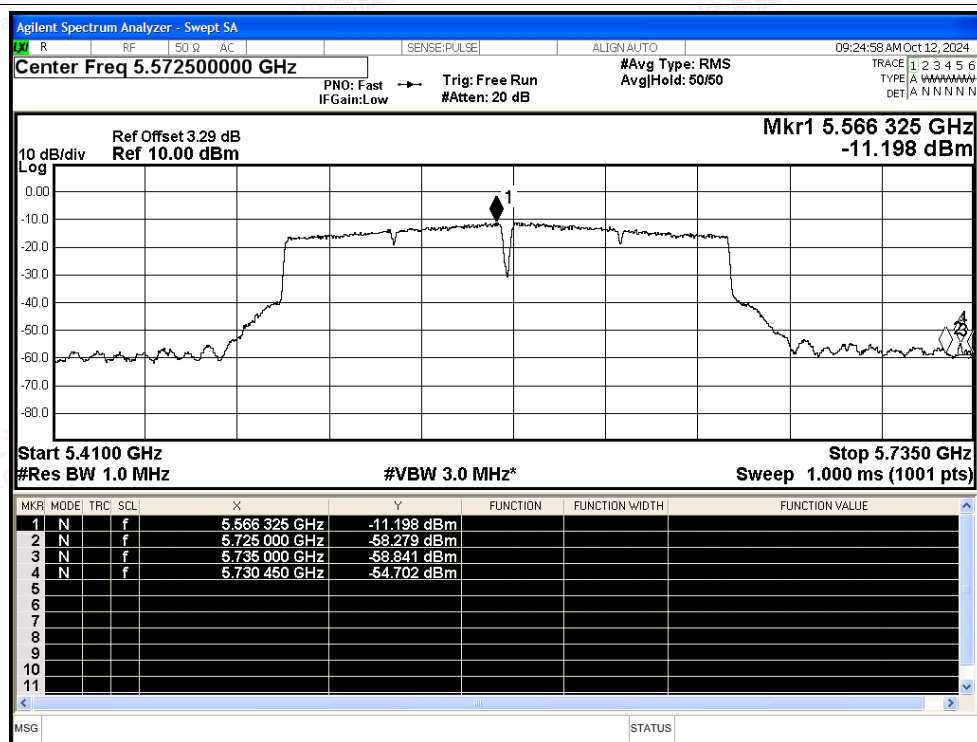




Restrict Band NVNT ac160 5570MHz Ant1 Peak

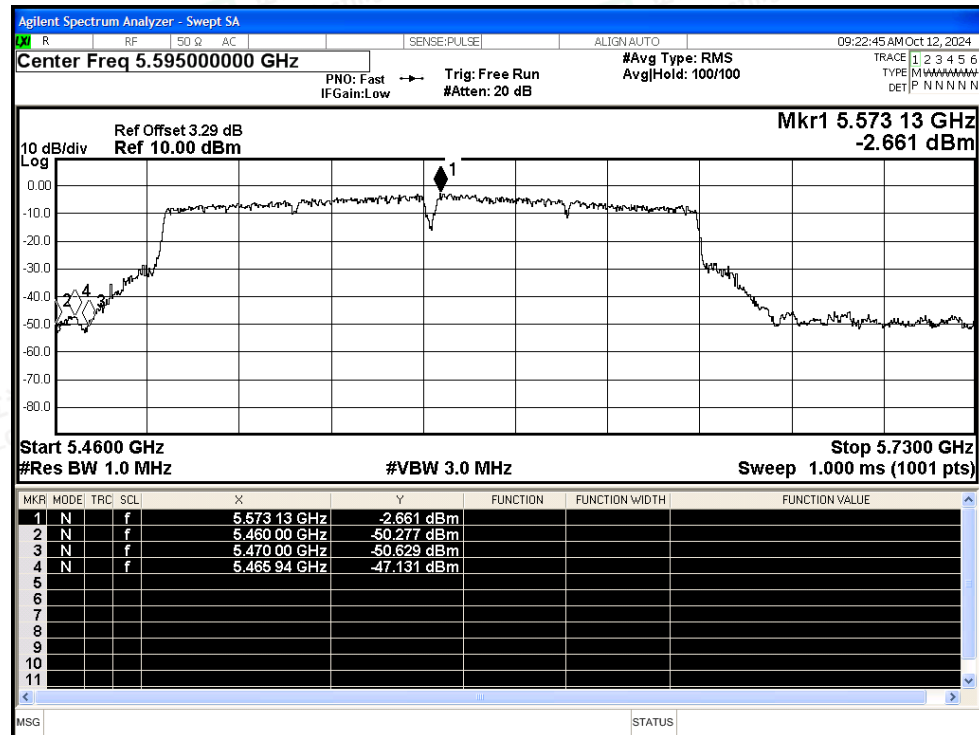


Restrict Band NVNT ac160 5570MHz Ant1 Average

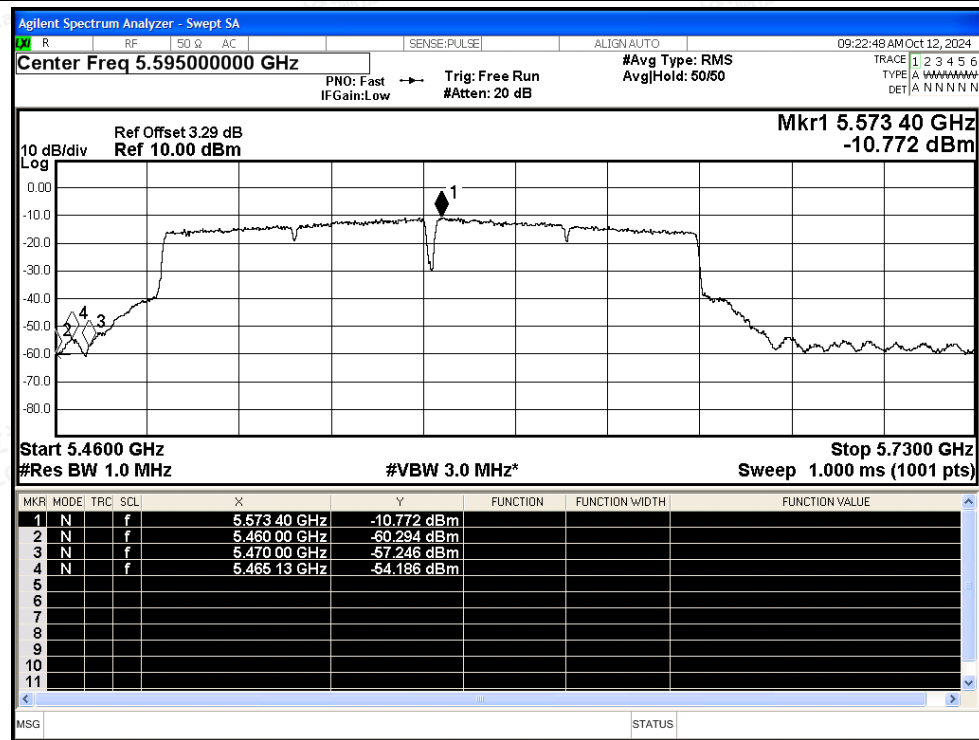




Restrict Band NVNT ax160 5570MHz Ant1 Peak

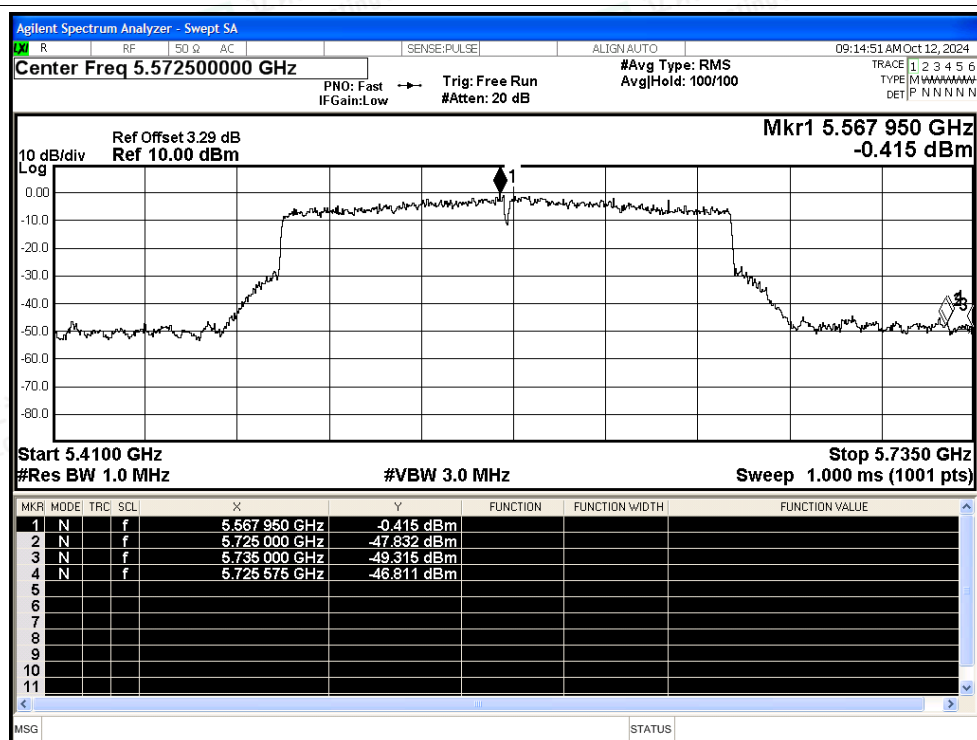


Restrict Band NVNT ax160 5570MHz Ant1 Average

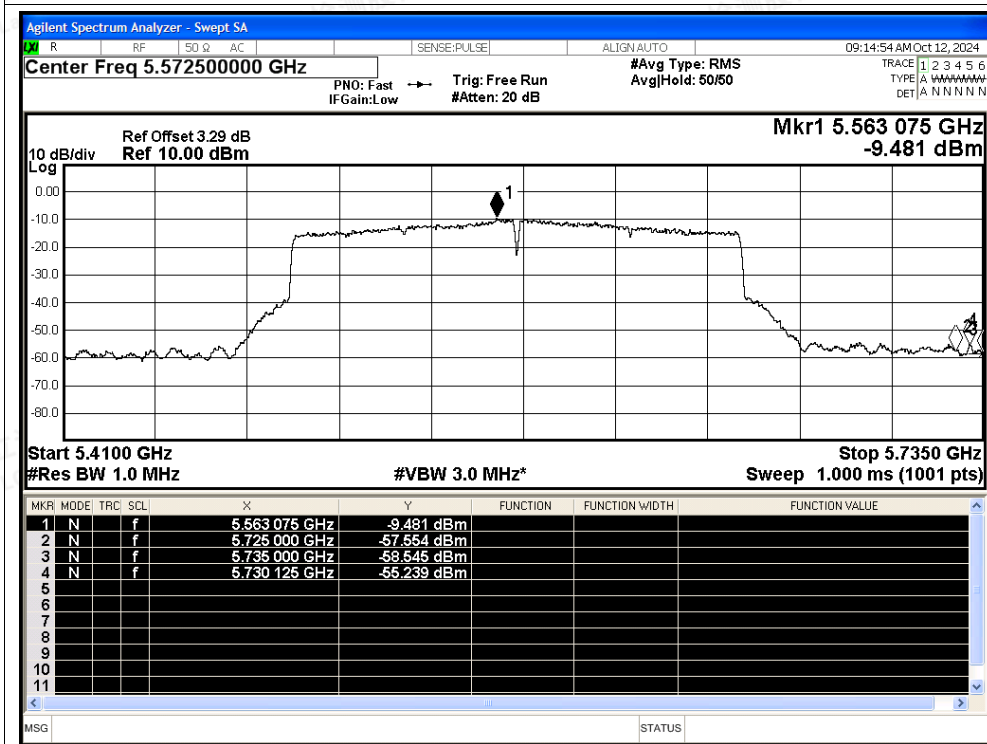




Restrict Band NVNT ax160 5570MHz Ant1 Peak

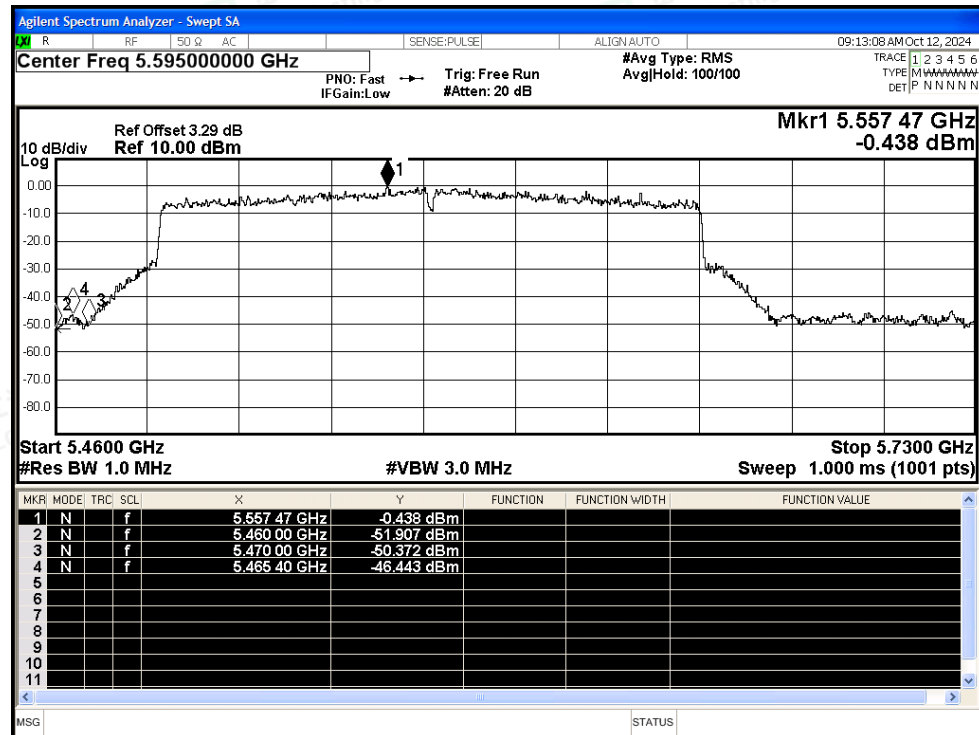


Restrict Band NVNT ax160 5570MHz Ant1 Average

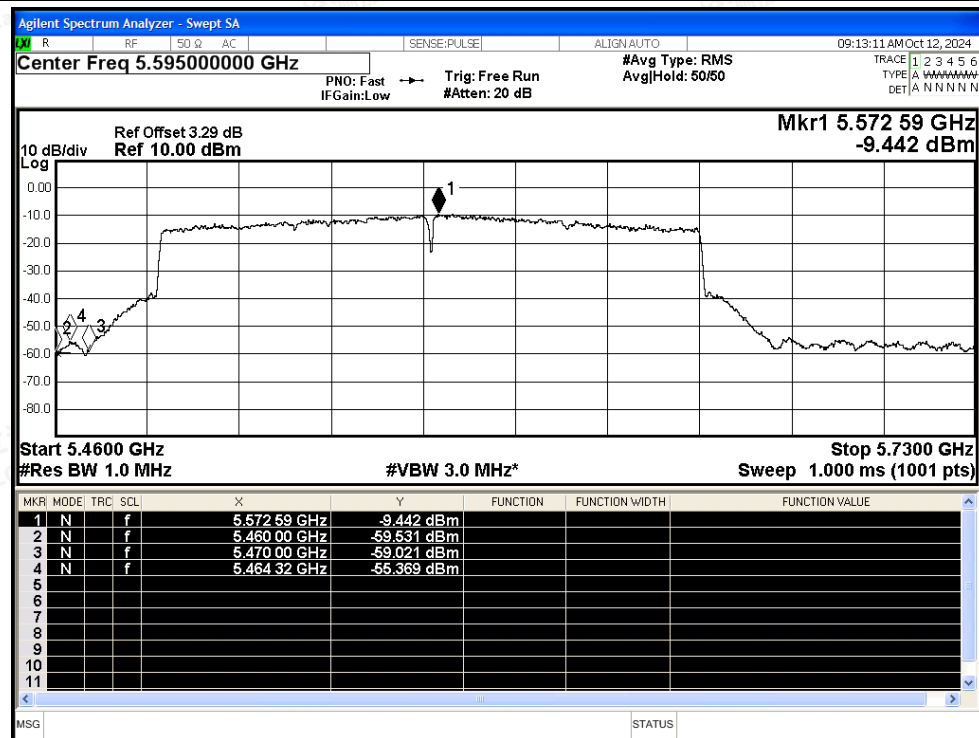




Restrict Band NVNT ax20 5500MHz Ant1 Peak

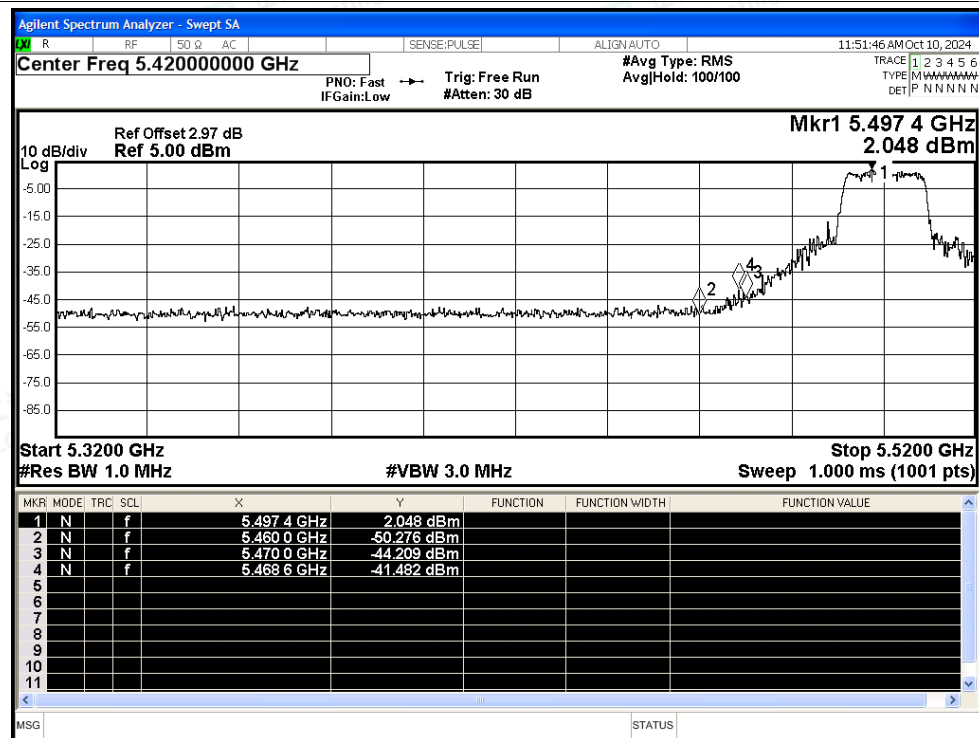


Restrict Band NVNT ax20 5500MHz Ant1 Average

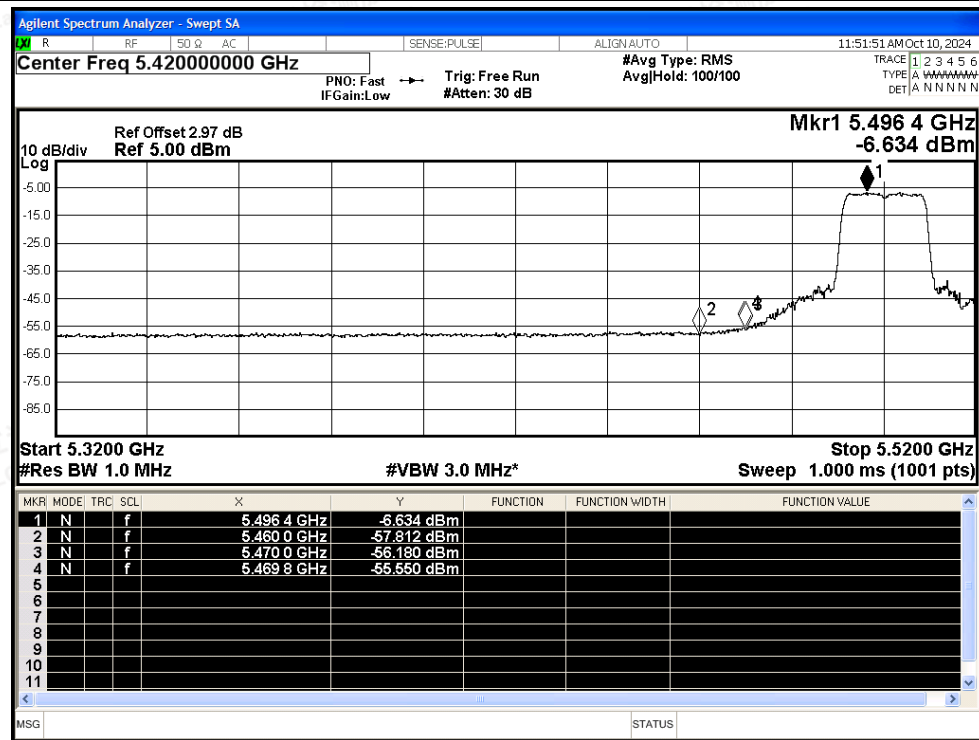




Restrict Band NVNT ax20 5700MHz Ant1 Peak

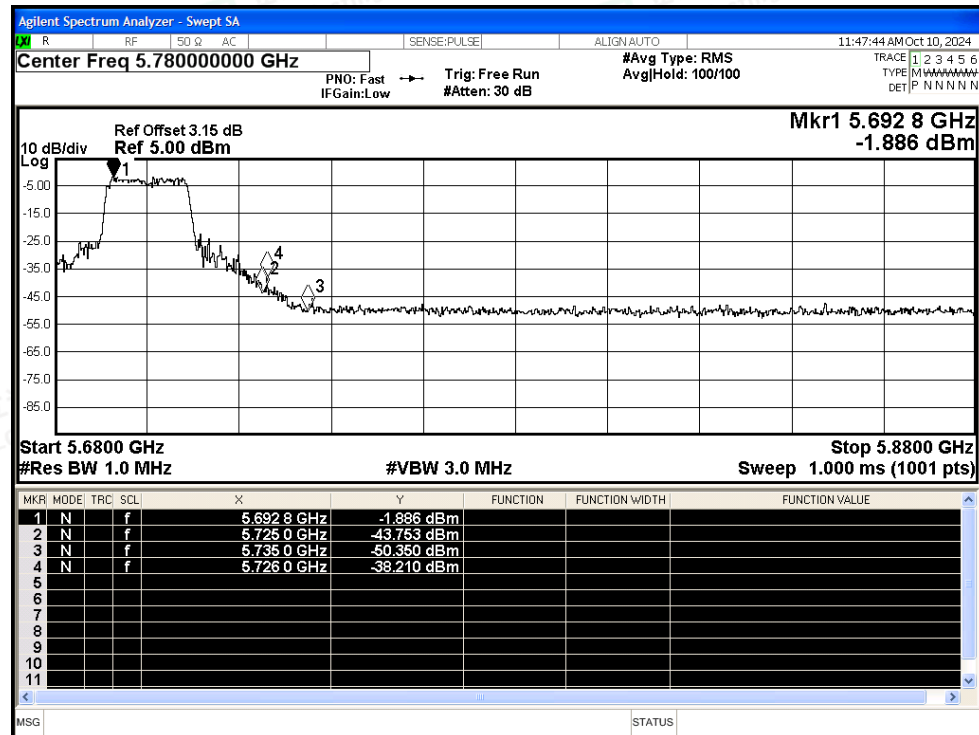


Restrict Band NVNT ax20 5700MHz Ant1 Average

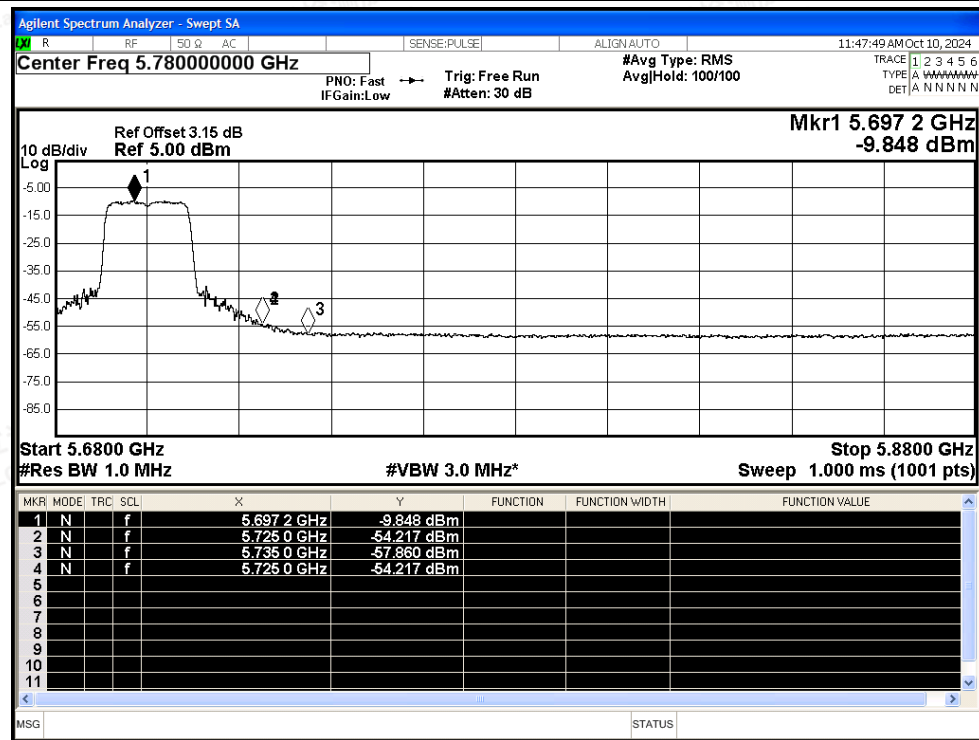




Restrict Band NVNT ax40 5510MHz Ant1 Peak

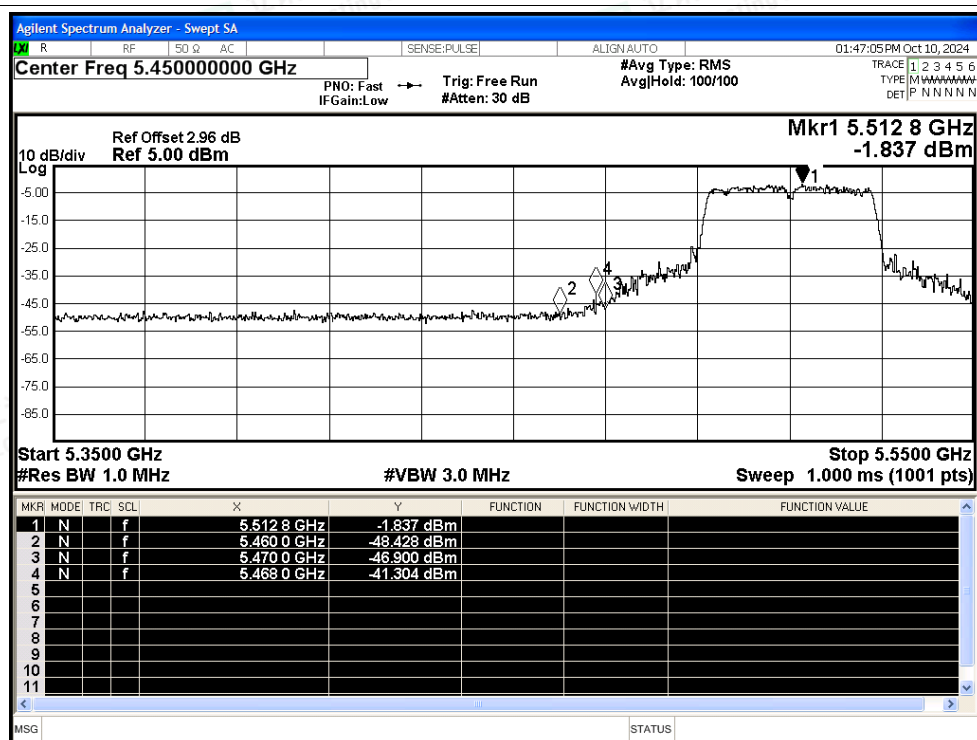


Restrict Band NVNT ax40 5510MHz Ant1 Average

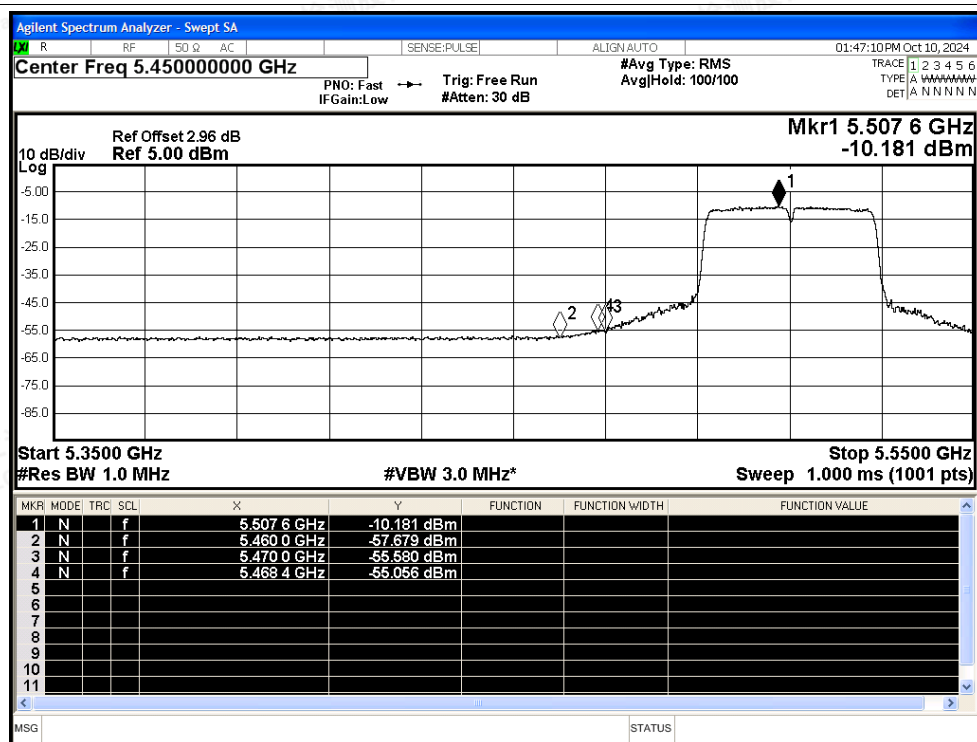




Restrict Band NVNT ax40 5670MHz Ant1 Peak

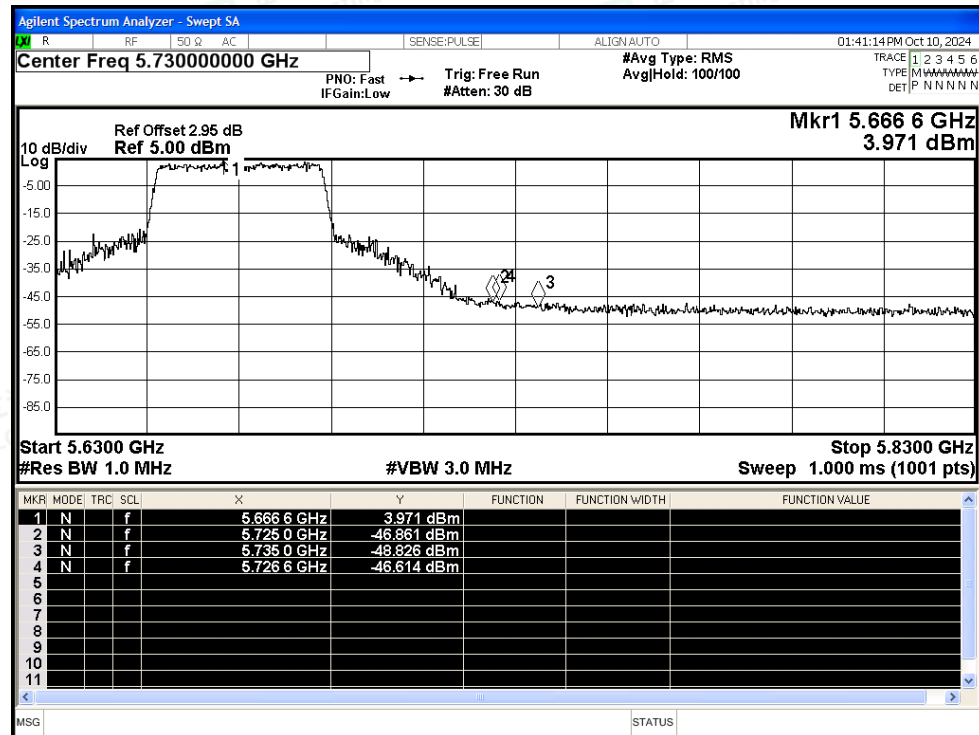


Restrict Band NVNT ax40 5670MHz Ant1 Average

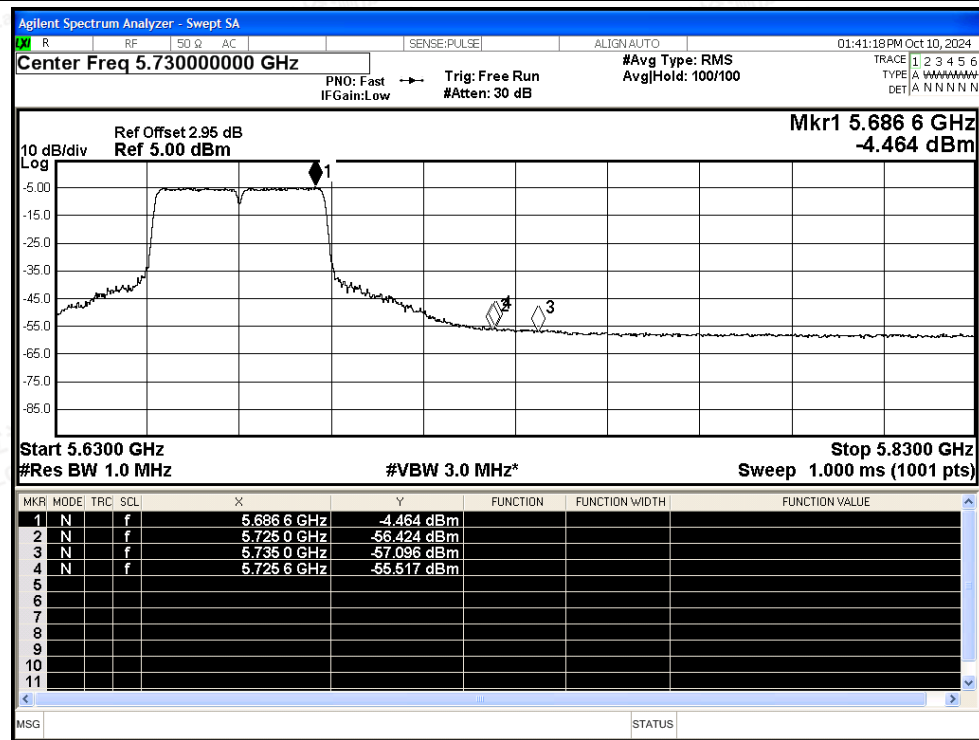




Restrict Band NVNT ax80 5530MHz Ant1 Peak

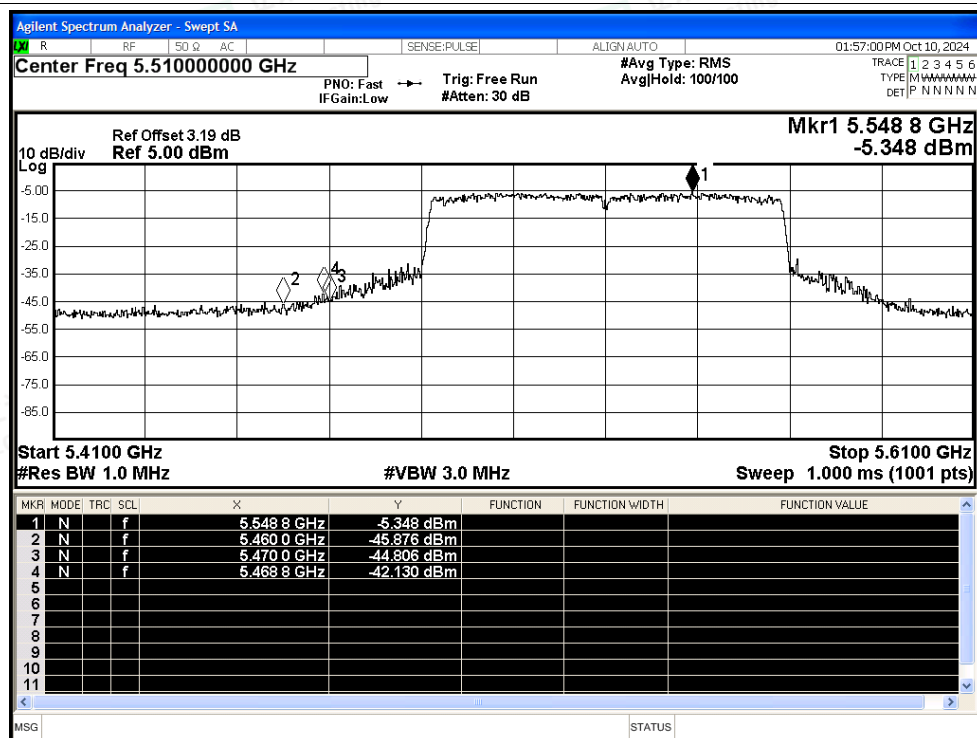


Restrict Band NVNT ax80 5530MHz Ant1 Average

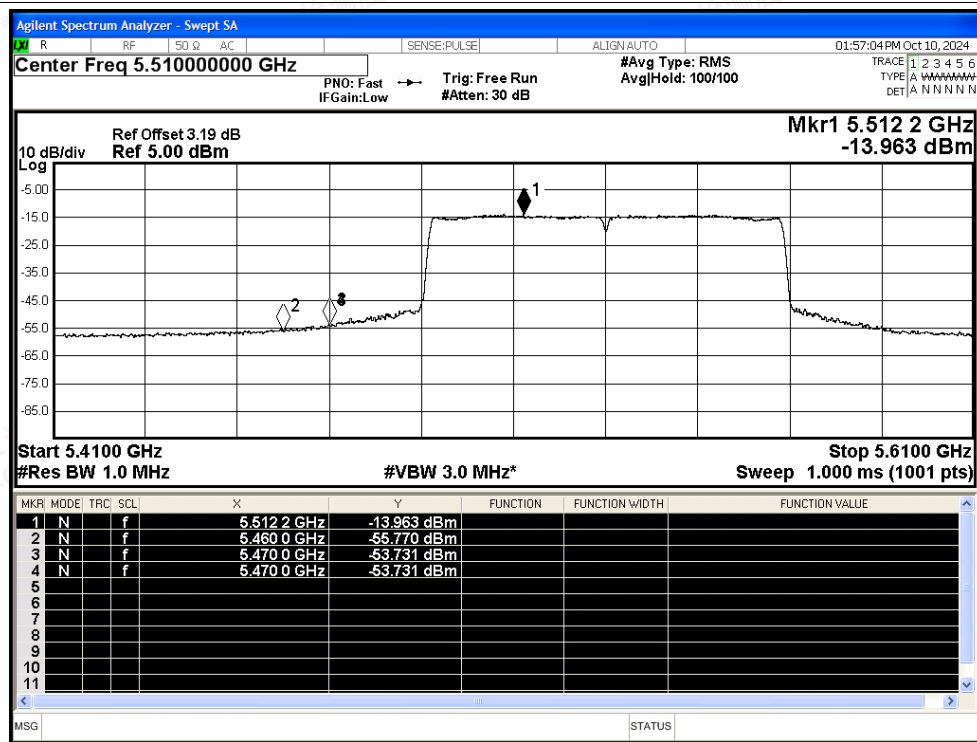




Restrict Band NVNT ax80 5610MHz Ant1 Peak

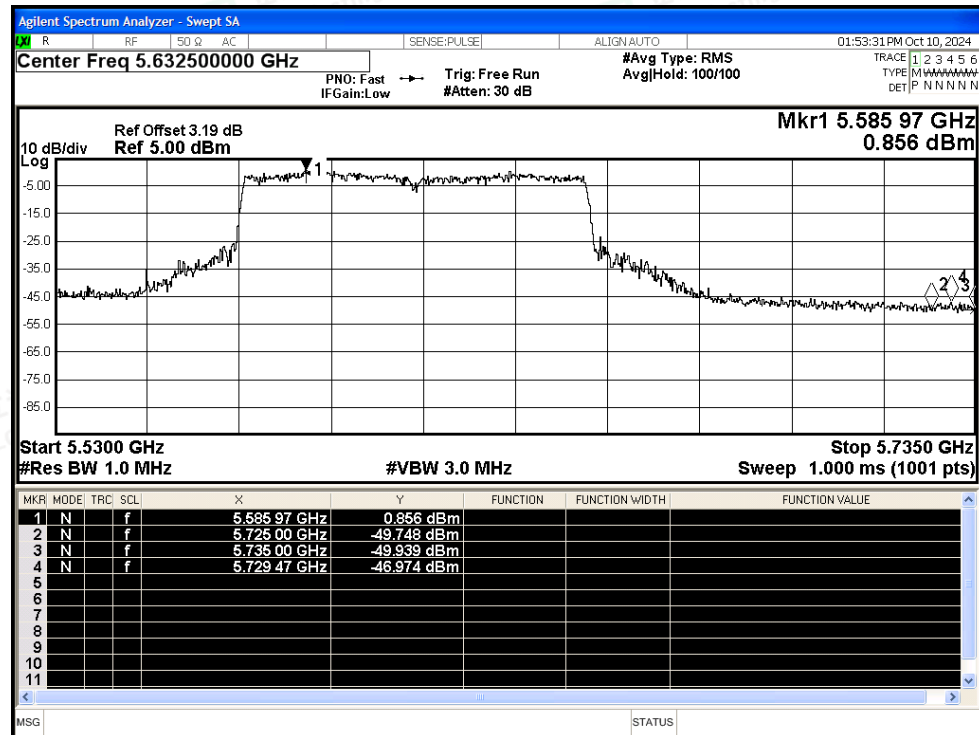

Restrict Band NVNT ax80 5610MHz Ant1 Average

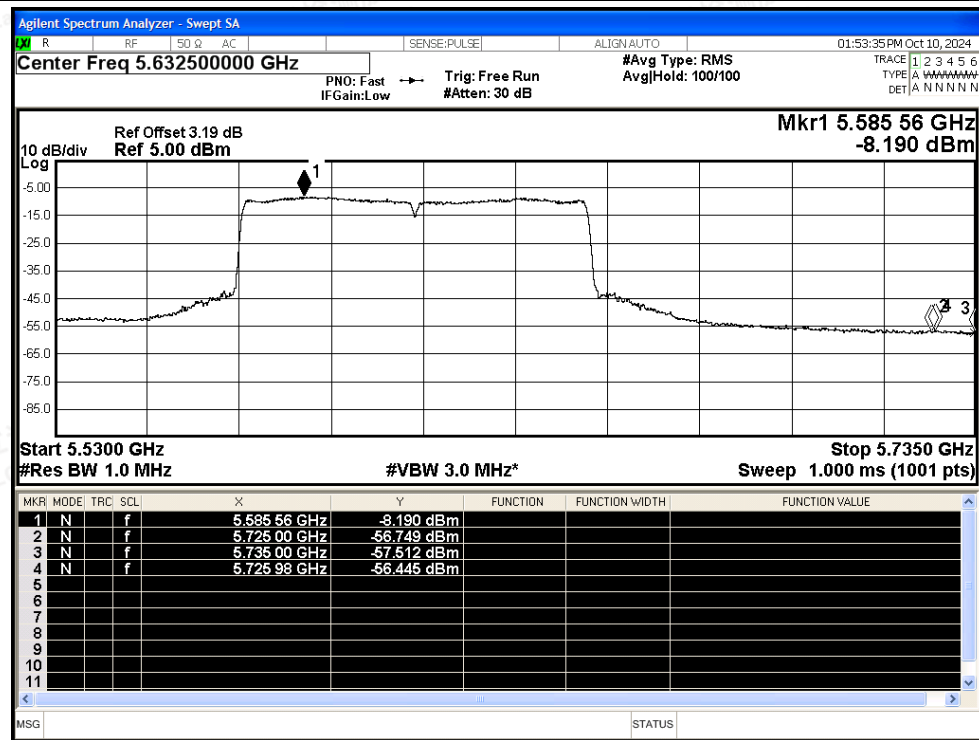



Condition	Mode	Frequency (MHz)	Antenna	Spur Freq (MHz)	Power (dBm)	Gain (dBi)	Duty Factor (dB)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	a	5500	Ant2	5460	-49.58	3.09	-	48.74	Peak	68.2	Pass
NVNT	a	5500	Ant2	5460	-57.41	3.09	0.24	41.15	Average	54	Pass
NVNT	a	5500	Ant2	5469.4	-39.04	3.09	-	59.28	Peak	68.2	Pass
NVNT	a	5500	Ant2	5468.6	-54.59	3.09	0.24	43.97	Average	54	Pass
NVNT	a	5500	Ant2	5470	-42.26	3.09	-	56.06	Peak	68.2	Pass
NVNT	a	5500	Ant2	5470	-55.07	3.09	0.24	43.49	Average	54	Pass
NVNT	a	5700	Ant2	5725	-44.86	3.09	-	53.46	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-54.9	3.09	0.24	43.66	Average	54	Pass
NVNT	a	5700	Ant2	5725.6	-41.66	3.09	-	56.66	Peak	68.2	Pass
NVNT	a	5700	Ant2	5725	-54.9	3.09	0.24	43.66	Average	54	Pass
NVNT	a	5700	Ant2	5735	-48.89	3.09	-	49.43	Peak	68.2	Pass
NVNT	a	5700	Ant2	5735	-57.25	3.09	0.24	41.31	Average	54	Pass
NVNT	n20	5500	Ant2	5460	-48.93	3.09	-	49.39	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5460	-57.12	3.09	0.12	41.32	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-43.58	3.09	-	54.74	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5469.8	-55.41	3.09	0.12	43.03	Average	54	Pass
NVNT	n20	5500	Ant2	5470	-43.58	3.09	-	54.74	Peak	68.2	Pass
NVNT	n20	5500	Ant2	5470	-55.73	3.09	0.12	42.71	Average	54	Pass
NVNT	n20	5700	Ant2	5725	-40.91	3.09	-	57.41	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-53.48	3.09	0.12	44.96	Average	54	Pass
NVNT	n20	5700	Ant2	5726.4	-37.88	3.09	-	60.44	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5725	-53.48	3.09	0.12	44.96	Average	54	Pass
NVNT	n20	5700	Ant2	5735	-47.65	3.09	-	50.67	Peak	68.2	Pass
NVNT	n20	5700	Ant2	5735	-58.11	3.09	0.12	40.33	Average	54	Pass
NVNT	n40	5510	Ant2	5460	-49.61	3.09	-	48.71	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5460	-57.74	3.09	0.12	40.7	Average	54	Pass
NVNT	n40	5510	Ant2	5469.4	-42.61	3.09	-	55.71	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5469.8	-54.27	3.09	0.12	44.17	Average	54	Pass
NVNT	n40	5510	Ant2	5470	-43.05	3.09	-	55.27	Peak	68.2	Pass
NVNT	n40	5510	Ant2	5470	-54.71	3.09	0.12	43.73	Average	54	Pass
NVNT	n40	5670	Ant2	5725	-50.03	3.09	-	48.29	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725	-57.5	3.09	0.12	40.94	Average	54	Pass
NVNT	n40	5670	Ant2	5727.6	-47.68	3.09	-	50.64	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5725.2	-56.7	3.09	0.12	41.74	Average	54	Pass
NVNT	n40	5670	Ant2	5735	-49.86	3.09	-	48.46	Peak	68.2	Pass
NVNT	n40	5670	Ant2	5735	-57.74	3.09	0.12	40.7	Average	54	Pass
NVNT	ac20	5500	Ant2	5460	-49.66	3.09	-	48.66	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac20	5500	Ant2	5460	-57.56	3.09	0.12	40.88	Average	54	Pass
NVNT	ac20	5500	Ant2	5467	-42.45	3.09	-	55.87	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5469.4	-55.05	3.09	0.12	43.39	Average	54	Pass
NVNT	ac20	5500	Ant2	5470	-42.46	3.09	-	55.86	Peak	68.2	Pass
NVNT	ac20	5500	Ant2	5470	-55.82	3.09	0.12	42.62	Average	54	Pass
NVNT	ac20	5700	Ant2	5725	-38.59	3.09	-	59.73	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5725	-53.83	3.09	0.12	44.61	Average	54	Pass
NVNT	ac20	5700	Ant2	5725.6	-37.49	3.09	-	60.83	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5726.8	-51.82	3.09	0.12	46.62	Average	54	Pass
NVNT	ac20	5700	Ant2	5735	-49.73	3.09	-	48.59	Peak	68.2	Pass
NVNT	ac20	5700	Ant2	5735	-57.37	3.09	0.12	41.07	Average	54	Pass
NVNT	ac40	5510	Ant2	5460	-50.38	3.09	-	47.94	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5460	-57.86	3.09	0.12	40.58	Average	54	Pass
NVNT	ac40	5510	Ant2	5469	-38.92	3.09	-	59.4	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5469.8	-54.36	3.09	0.12	44.08	Average	54	Pass
NVNT	ac40	5510	Ant2	5470	-43.04	3.09	-	55.28	Peak	68.2	Pass
NVNT	ac40	5510	Ant2	5470	-54.89	3.09	0.12	43.55	Average	54	Pass
NVNT	ac40	5670	Ant2	5725	-46.92	3.09	-	51.4	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725	-56.39	3.09	0.12	42.05	Average	54	Pass
NVNT	ac40	5670	Ant2	5728.4	-45.49	3.09	-	52.83	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5725.8	-56.34	3.09	0.12	42.1	Average	54	Pass
NVNT	ac40	5670	Ant2	5735	-48.74	3.09	-	49.58	Peak	68.2	Pass
NVNT	ac40	5670	Ant2	5735	-57.68	3.09	0.12	40.76	Average	54	Pass
NVNT	ac80	5530	Ant2	5460	-47.1	3.09	-	51.22	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5460	-56.53	3.09	0.25	42.04	Average	54	Pass
NVNT	ac80	5530	Ant2	5464.8	-42.86	3.09	-	55.46	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5469.4	-54.04	3.09	0.25	44.53	Average	54	Pass
NVNT	ac80	5530	Ant2	5470	-44.37	3.09	-	53.95	Peak	68.2	Pass
NVNT	ac80	5530	Ant2	5470	-55.27	3.09	0.25	43.3	Average	54	Pass
NVNT	ac80	5610	Ant2	5725	-50.07	3.09	-	48.25	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5725	-57.54	3.09	0.25	41.03	Average	54	Pass
NVNT	ac80	5610	Ant2	5731.105	-47.47	3.09	-	50.85	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5728.44	-56.91	3.09	0.25	41.66	Average	54	Pass
NVNT	ac80	5610	Ant2	5735	-50.63	3.09	-	47.69	Peak	68.2	Pass
NVNT	ac80	5610	Ant2	5735	-57.82	3.09	0.25	40.75	Average	54	Pass
NVNT	ac160	5570	Ant2	5725	-50.22	3.09	-	48.1	Peak	68.2	Pass
NVNT	ac160	5570	Ant2	5725	-57.79	3.09	0.41	40.94	Average	54	Pass
NVNT	ac160	5570	Ant2	5730.125	-48.14	3.09	-	50.18	Peak	68.2	Pass
NVNT	ac160	5570	Ant2	5730.45	-54.94	3.09	0.41	43.79	Average	54	Pass
NVNT	ac160	5570	Ant2	5735	-51.05	3.09	-	47.27	Peak	68.2	Pass





NVNT	ac160	5570	Ant2	5735	-59.31	3.09	0.41	39.42	Average	54	Pass
NVNT	ac160	5570	Ant2	5460	-51.92	3.09	-	46.4	Peak	68.2	Pass
NVNT	ac160	5570	Ant2	5460	-60.32	3.09	0.41	38.41	Average	54	Pass
NVNT	ac160	5570	Ant2	5464.59	-45.85	3.09	-	52.47	Peak	68.2	Pass
NVNT	ac160	5570	Ant2	5464.86	-54.74	3.09	0.41	43.99	Average	54	Pass
NVNT	ac160	5570	Ant2	5470	-50.39	3.09	-	47.93	Peak	68.2	Pass
NVNT	ac160	5570	Ant2	5470	-59.19	3.09	0.41	39.54	Average	54	Pass
NVNT	ax160	5570	Ant2	5725	-51.76	3.09	-	46.56	Peak	68.2	Pass
NVNT	ax160	5570	Ant2	5725	-59.7	3.09	0.51	39.13	Average	54	Pass
NVNT	ax160	5570	Ant2	5730.125	-49.87	3.09	-	48.45	Peak	68.2	Pass
NVNT	ax160	5570	Ant2	5730.45	-56.78	3.09	0.51	42.05	Average	54	Pass
NVNT	ax160	5570	Ant2	5735	-52.48	3.09	-	45.84	Peak	68.2	Pass
NVNT	ax160	5570	Ant2	5735	-60.08	3.09	0.51	38.75	Average	54	Pass
NVNT	ax160	5570	Ant2	5460	-53.19	3.09	-	45.13	Peak	68.2	Pass
NVNT	ax160	5570	Ant2	5460	-61.92	3.09	0.51	36.91	Average	54	Pass
NVNT	ax160	5570	Ant2	5464.59	-48.74	3.09	-	49.58	Peak	68.2	Pass
NVNT	ax160	5570	Ant2	5465.13	-57.36	3.09	0.51	41.47	Average	54	Pass
NVNT	ax160	5570	Ant2	5470	-51.88	3.09	-	46.44	Peak	68.2	Pass
NVNT	ax160	5570	Ant2	5470	-60.82	3.09	0.51	38.01	Average	54	Pass
NVNT	ax20	5500	Ant2	5460	-50.38	3.09	-	47.94	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5460	-57.29	3.09	0.12	41.15	Average	54	Pass
NVNT	ax20	5500	Ant2	5469	-39.84	3.09	-	58.48	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-55.05	3.09	0.12	43.39	Average	54	Pass
NVNT	ax20	5500	Ant2	5470	-44.39	3.09	-	53.93	Peak	68.2	Pass
NVNT	ax20	5500	Ant2	5470	-55.05	3.09	0.12	43.39	Average	54	Pass
NVNT	ax20	5700	Ant2	5725	-41.56	3.09	-	56.76	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725	-53.45	3.09	0.12	44.99	Average	54	Pass
NVNT	ax20	5700	Ant2	5725.8	-37.79	3.09	-	60.53	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5725.2	-53.03	3.09	0.12	45.41	Average	54	Pass
NVNT	ax20	5700	Ant2	5735	-50.45	3.09	-	47.87	Peak	68.2	Pass
NVNT	ax20	5700	Ant2	5735	-57.32	3.09	0.12	41.12	Average	54	Pass
NVNT	ax40	5510	Ant2	5460	-47.87	3.09	-	50.45	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5460	-57.33	3.09	0.12	41.11	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-37.59	3.09	-	60.73	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5469	-54.29	3.09	0.12	44.15	Average	54	Pass
NVNT	ax40	5510	Ant2	5470	-37.59	3.09	-	60.73	Peak	68.2	Pass
NVNT	ax40	5510	Ant2	5470	-55.26	3.09	0.12	43.18	Average	54	Pass
NVNT	ax40	5670	Ant2	5725	-49.47	3.09	-	48.85	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5725	-56.7	3.09	0.12	41.74	Average	54	Pass
NVNT	ax40	5670	Ant2	5729	-46.92	3.09	-	51.4	Peak	68.2	Pass





NVNT	ax40	5670	Ant2	5726.4	-56.22	3.09	0.12	42.22	Average	54	Pass
NVNT	ax40	5670	Ant2	5735	-48.7	3.09	-	49.62	Peak	68.2	Pass
NVNT	ax40	5670	Ant2	5735	-56.75	3.09	0.12	41.69	Average	54	Pass
NVNT	ax80	5530	Ant2	5460	-48.9	3.09	-	49.42	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5460	-55.51	3.09	0.25	43.06	Average	54	Pass
NVNT	ax80	5530	Ant2	5469.8	-40.01	3.09	-	58.31	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5469.4	-54.12	3.09	0.25	44.45	Average	54	Pass
NVNT	ax80	5530	Ant2	5470	-44.93	3.09	-	53.39	Peak	68.2	Pass
NVNT	ax80	5530	Ant2	5470	-54.82	3.09	0.25	43.75	Average	54	Pass
NVNT	ax80	5610	Ant2	5725	-48.74	3.09	-	49.58	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725	-57.9	3.09	0.25	40.67	Average	54	Pass
NVNT	ax80	5610	Ant2	5728.44	-47.57	3.09	-	50.75	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5725.57	-57.05	3.09	0.25	41.52	Average	54	Pass
NVNT	ax80	5610	Ant2	5735	-48.94	3.09	-	49.38	Peak	68.2	Pass
NVNT	ax80	5610	Ant2	5735	-57.38	3.09	0.25	41.19	Average	54	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Restrict Band NVNT a 5500MHz Ant2 Peak

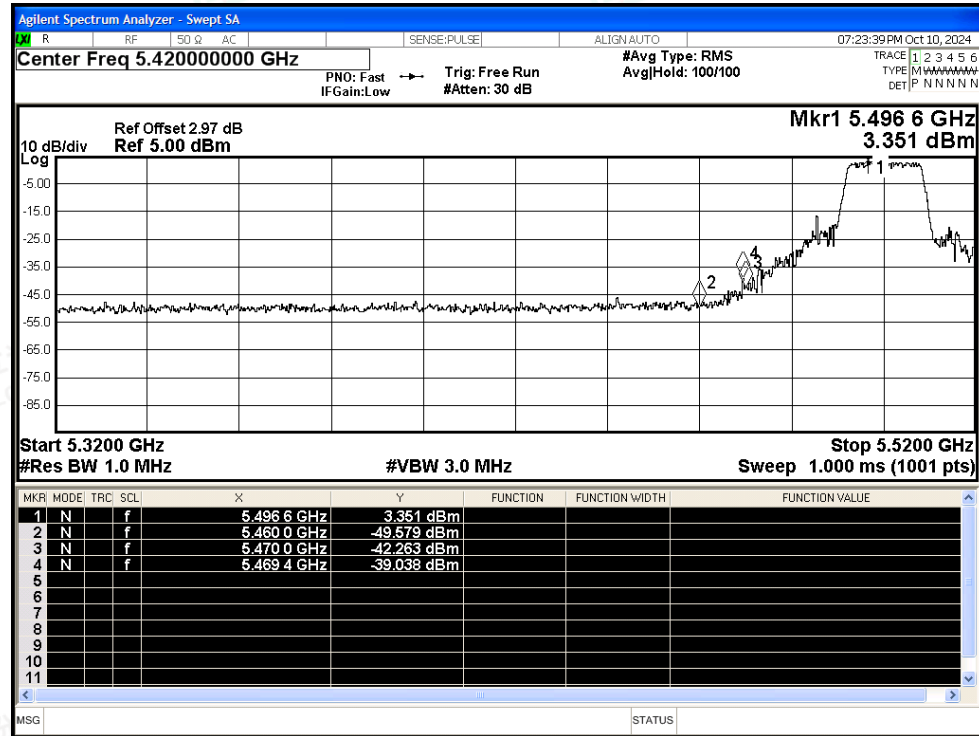


Restrict Band NVNT a 5500MHz Ant2 Average

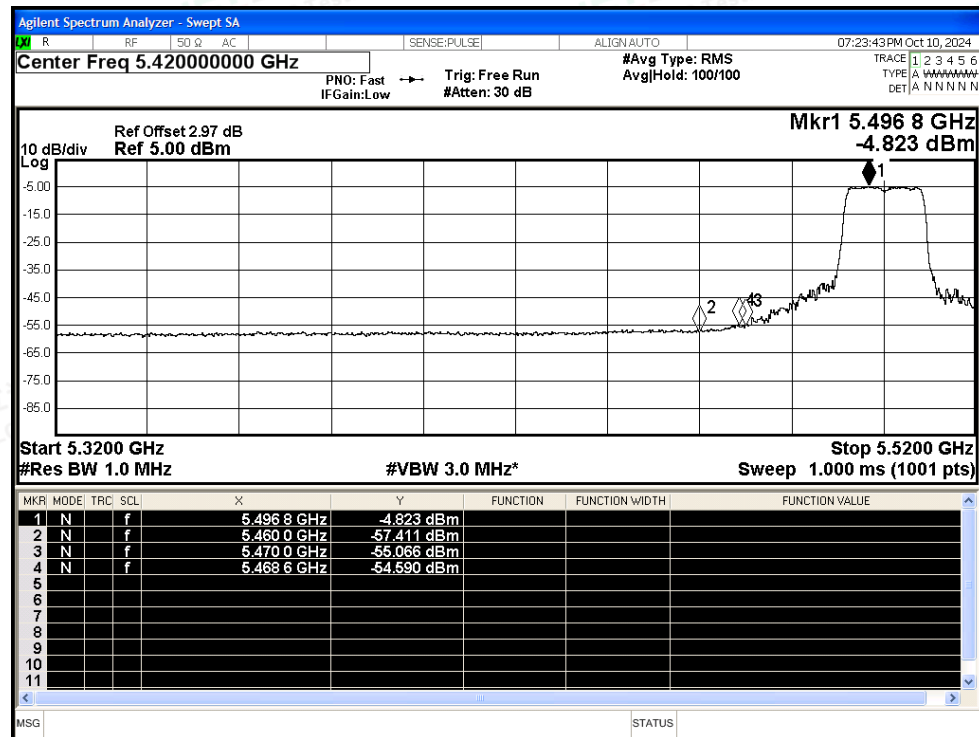




Restrict Band NVNT a 5700MHz Ant2 Peak

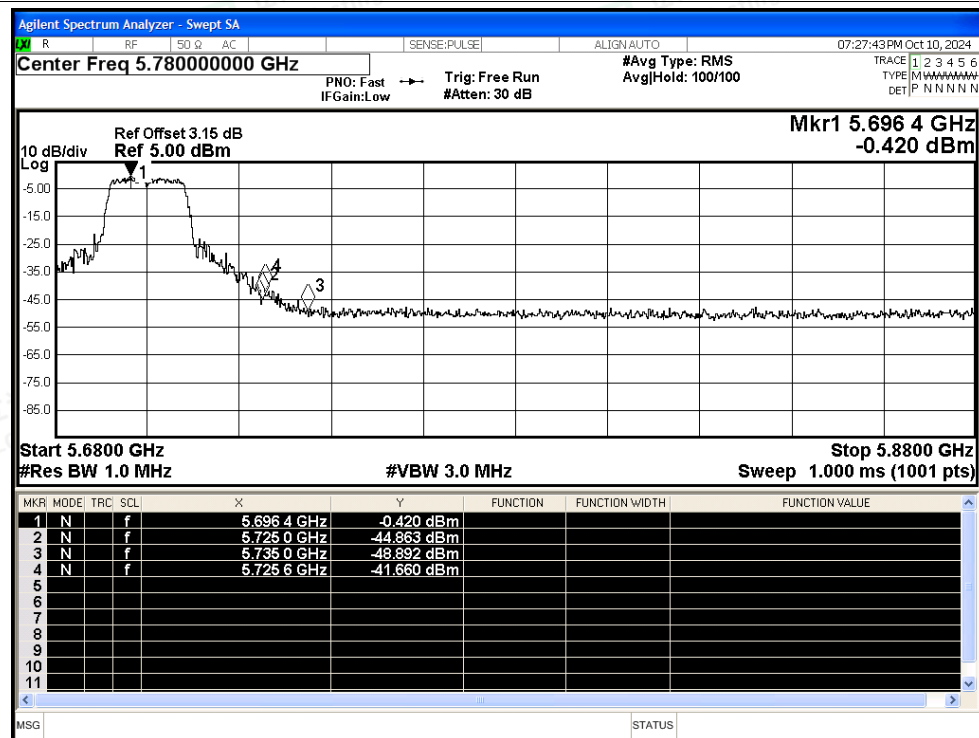


Restrict Band NVNT a 5700MHz Ant2 Average

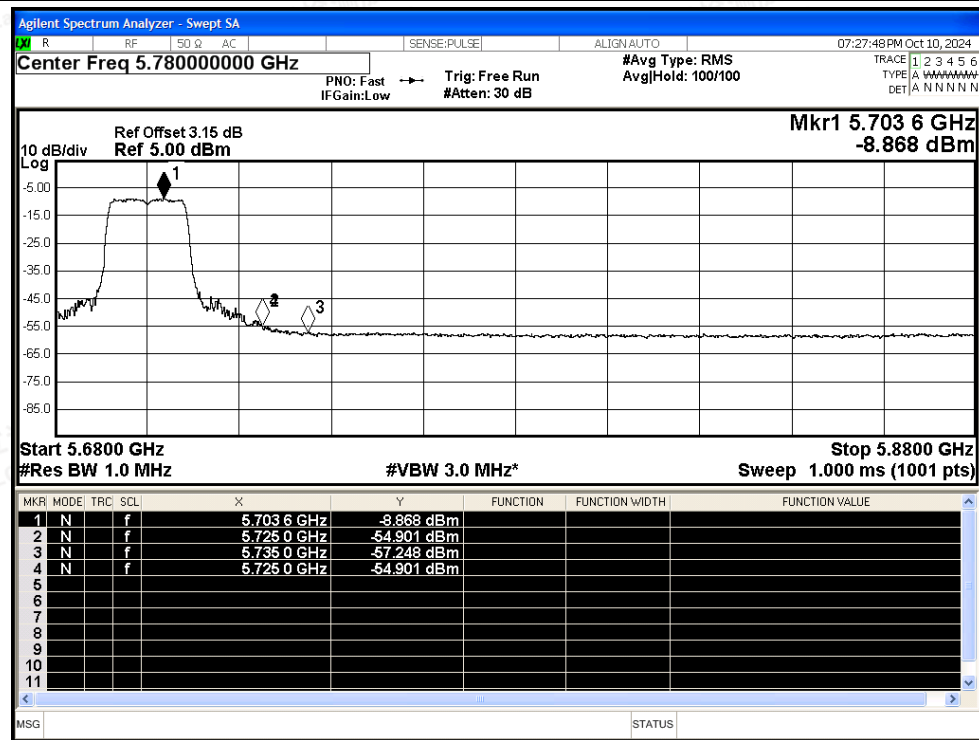




Restrict Band NVNT n20 5500MHz Ant2 Peak

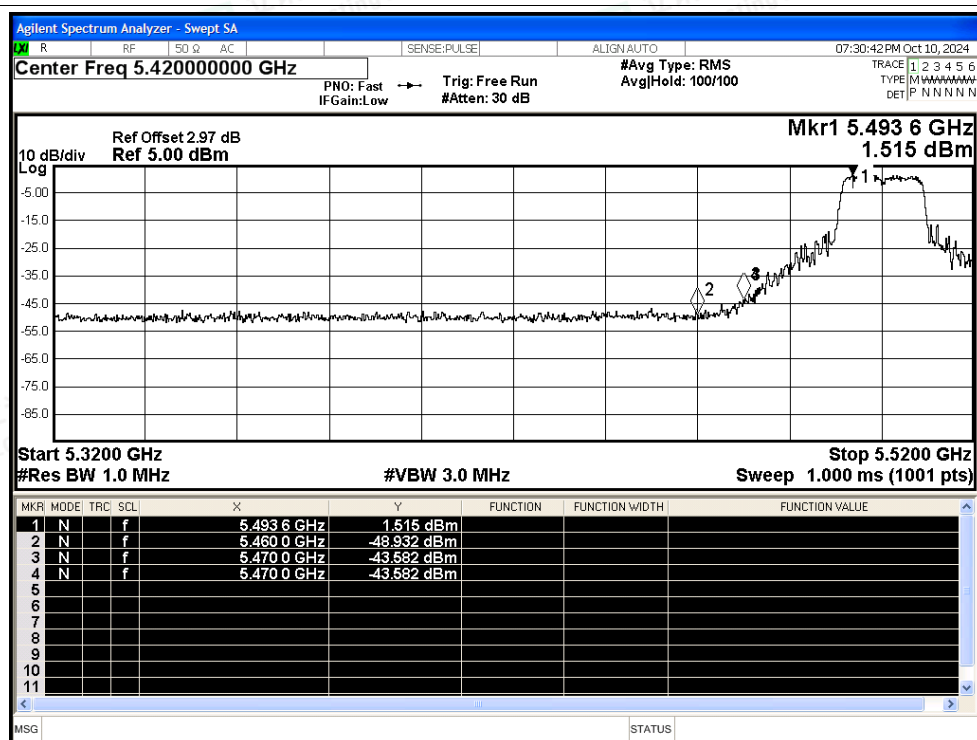


Restrict Band NVNT n20 5500MHz Ant2 Average

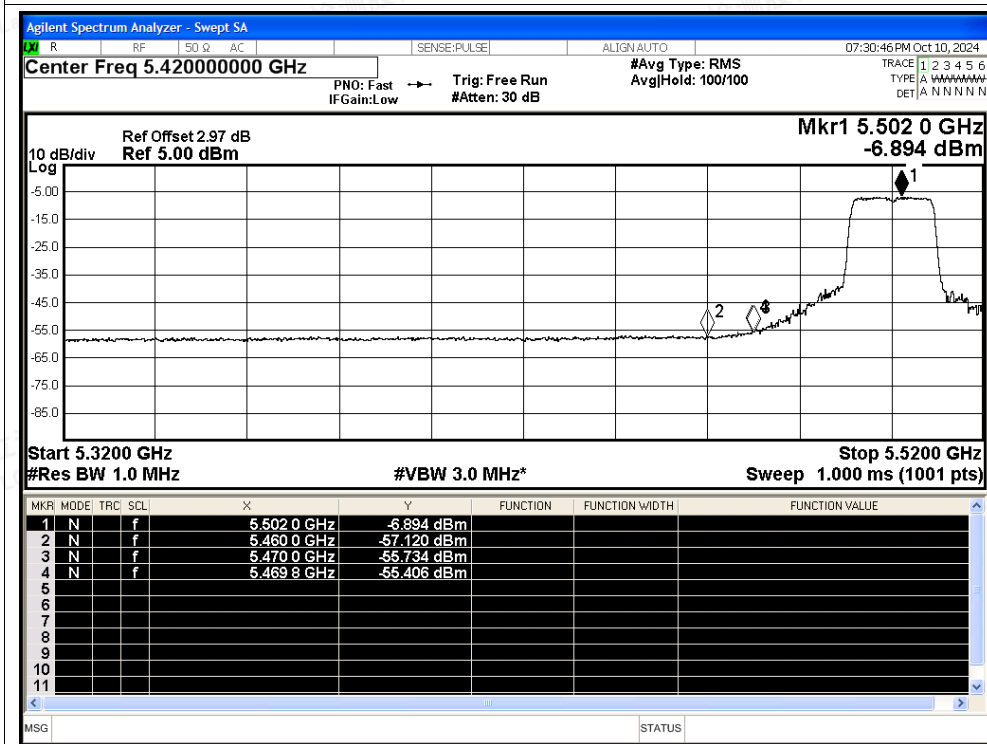




Restrict Band NVNT n20 5700MHz Ant2 Peak

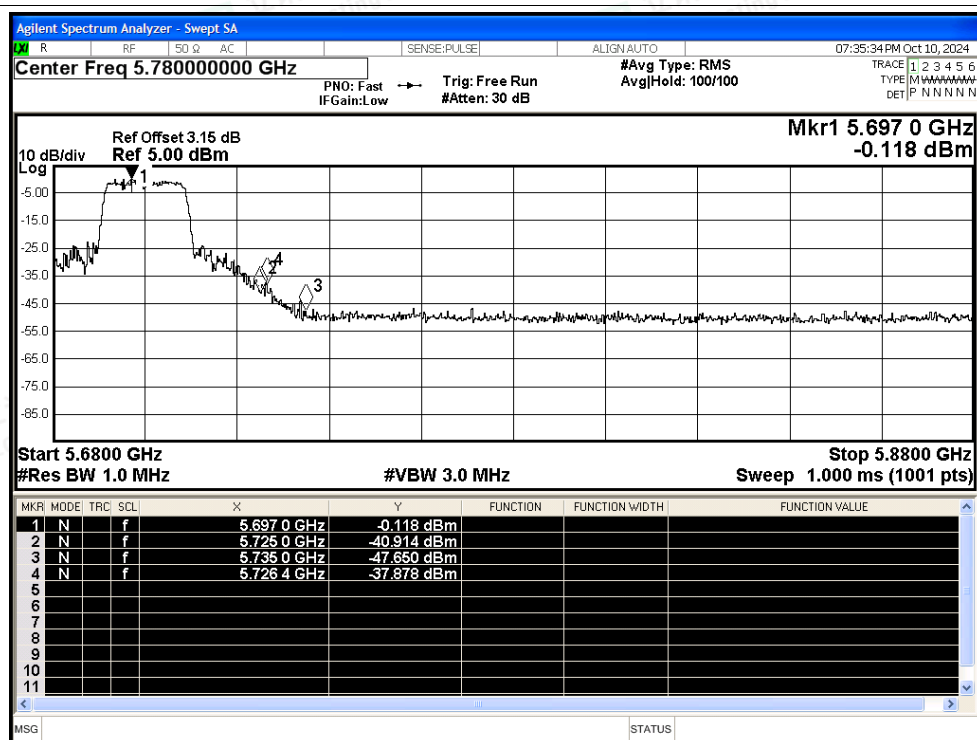


Restrict Band NVNT n20 5700MHz Ant2 Average

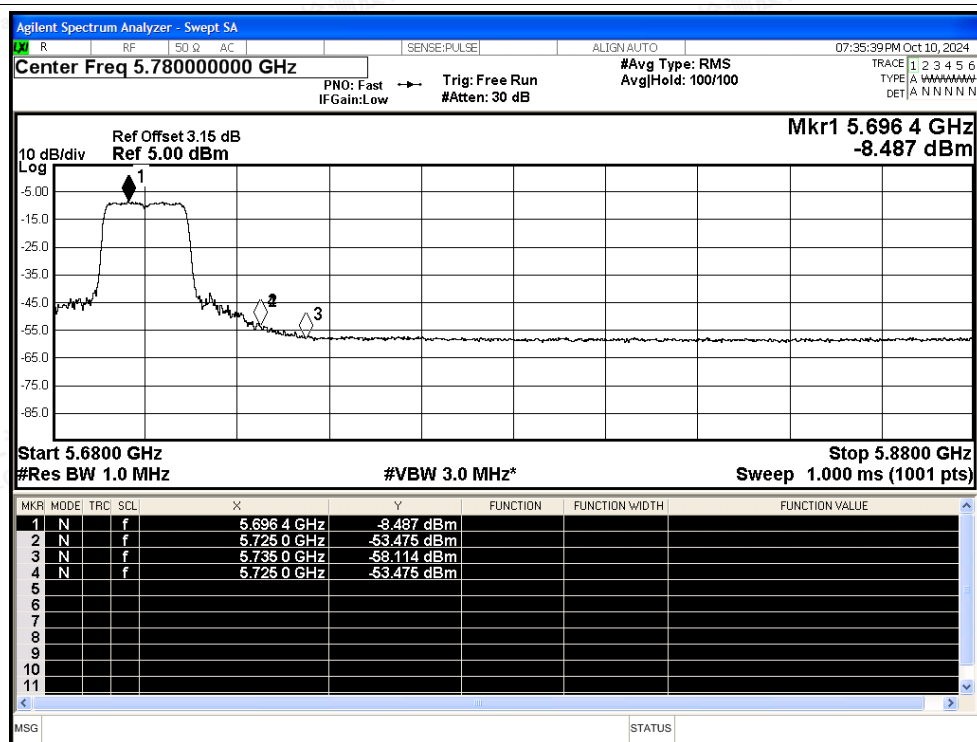




Restrict Band NVNT n40 5510MHz Ant2 Peak

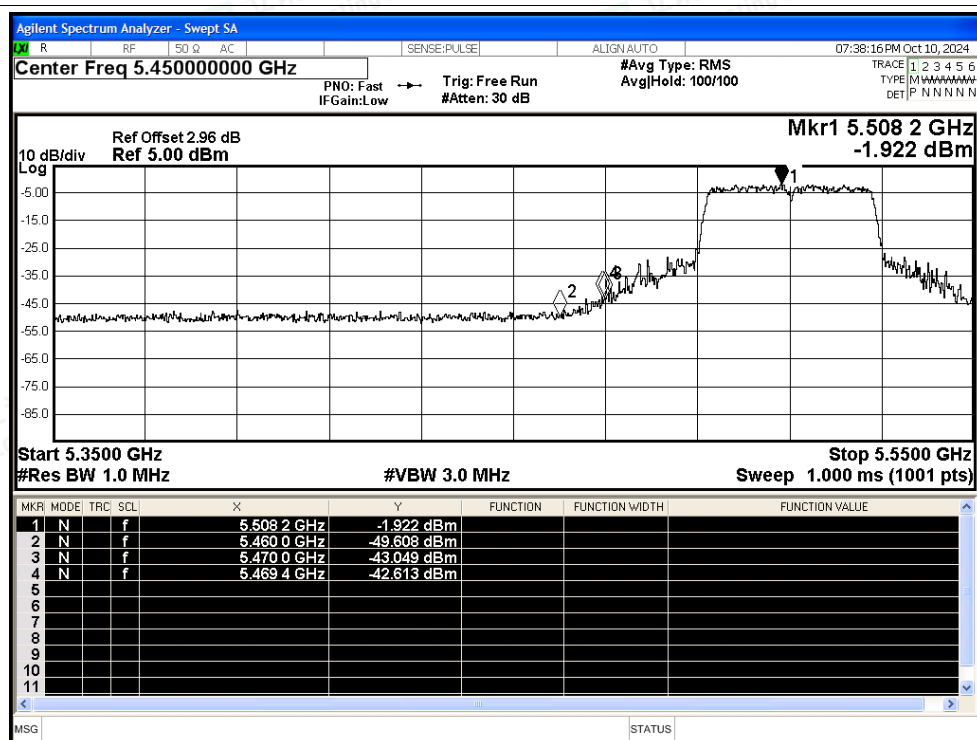


Restrict Band NVNT n40 5510MHz Ant2 Average

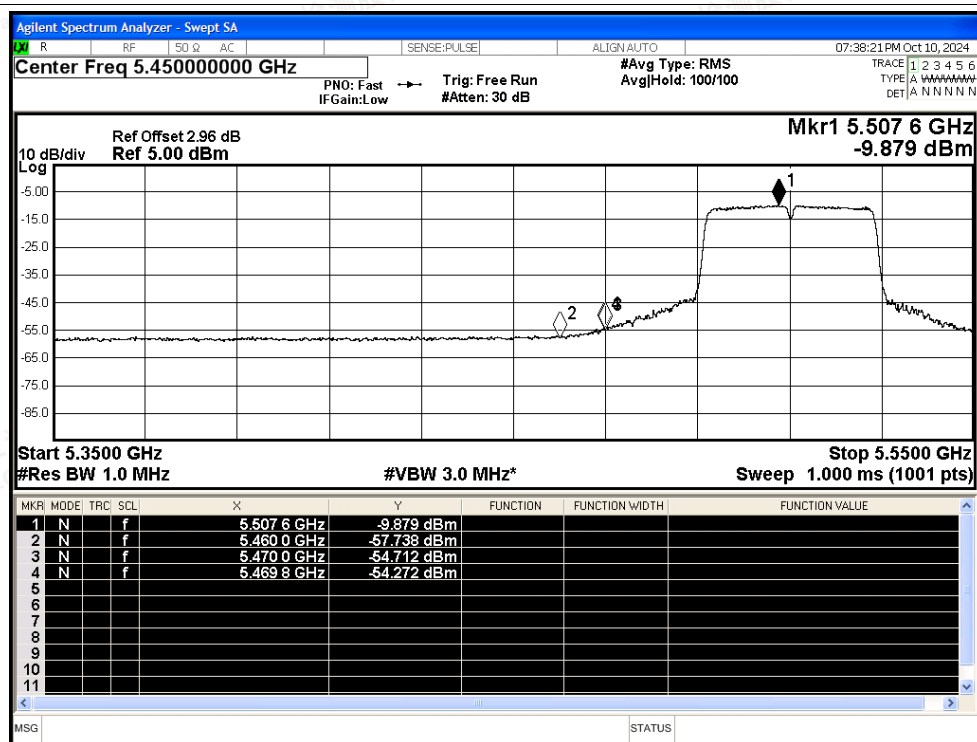


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Restrict Band NVNT n40 5670MHz Ant2 Peak

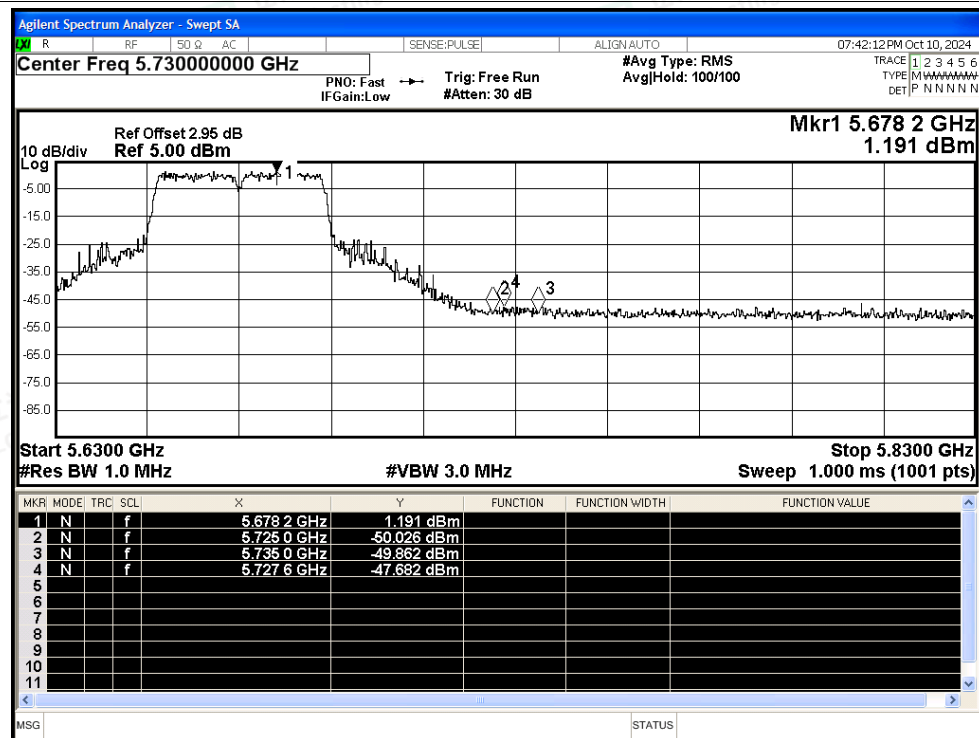


Restrict Band NVNT n40 5670MHz Ant2 Average

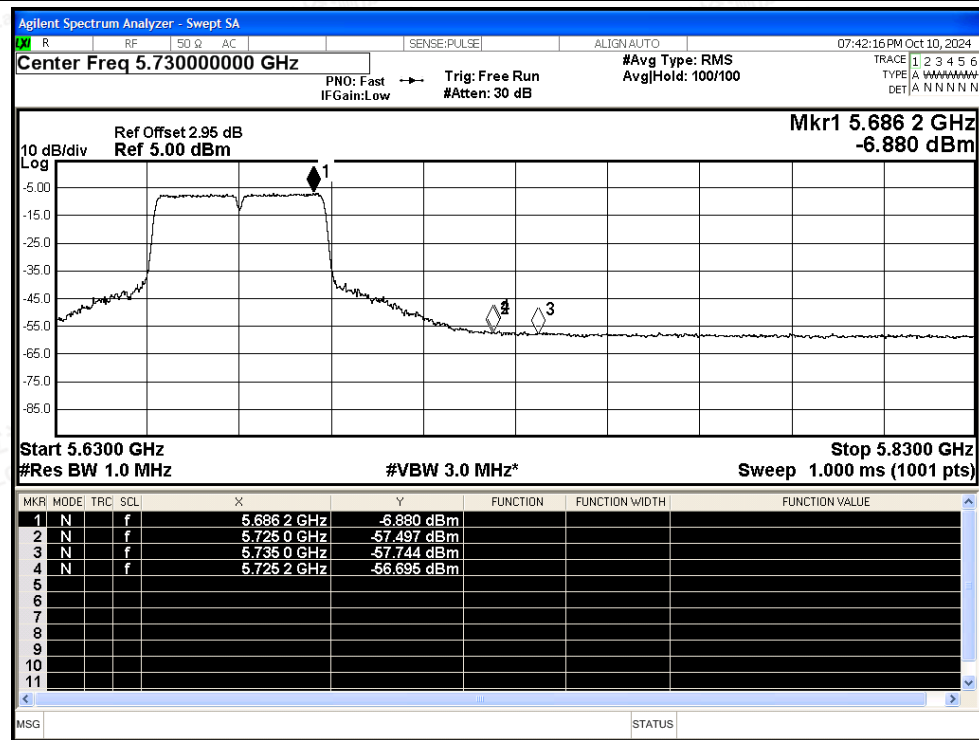




Restrict Band NVNT ac20 5500MHz Ant2 Peak

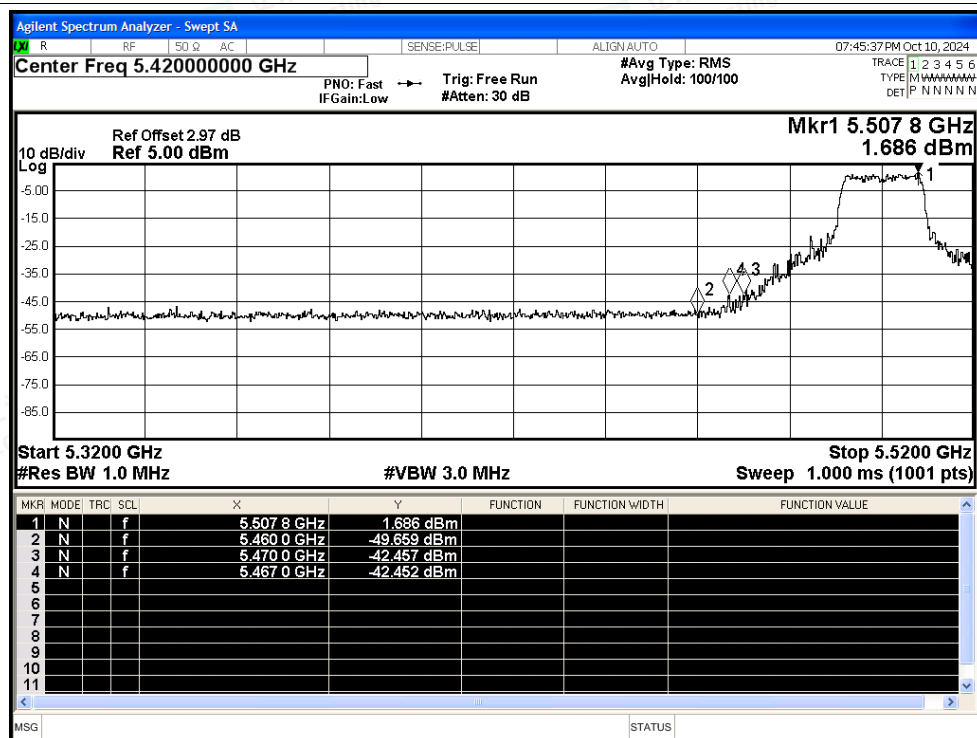


Restrict Band NVNT ac20 5500MHz Ant2 Average

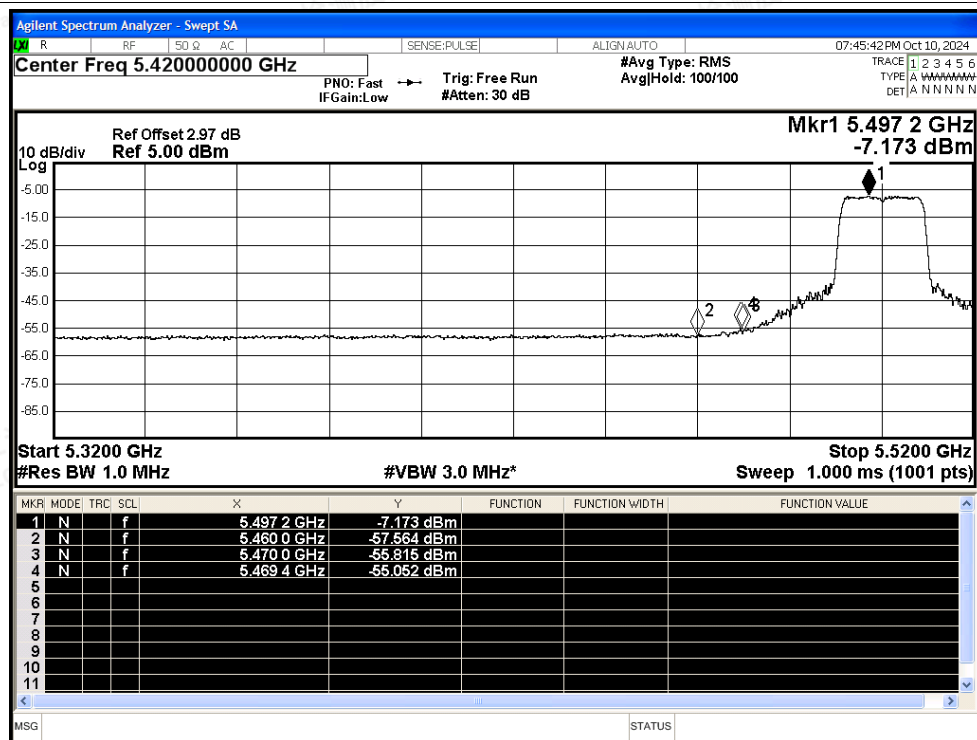




Restrict Band NVNT ac20 5700MHz Ant2 Peak

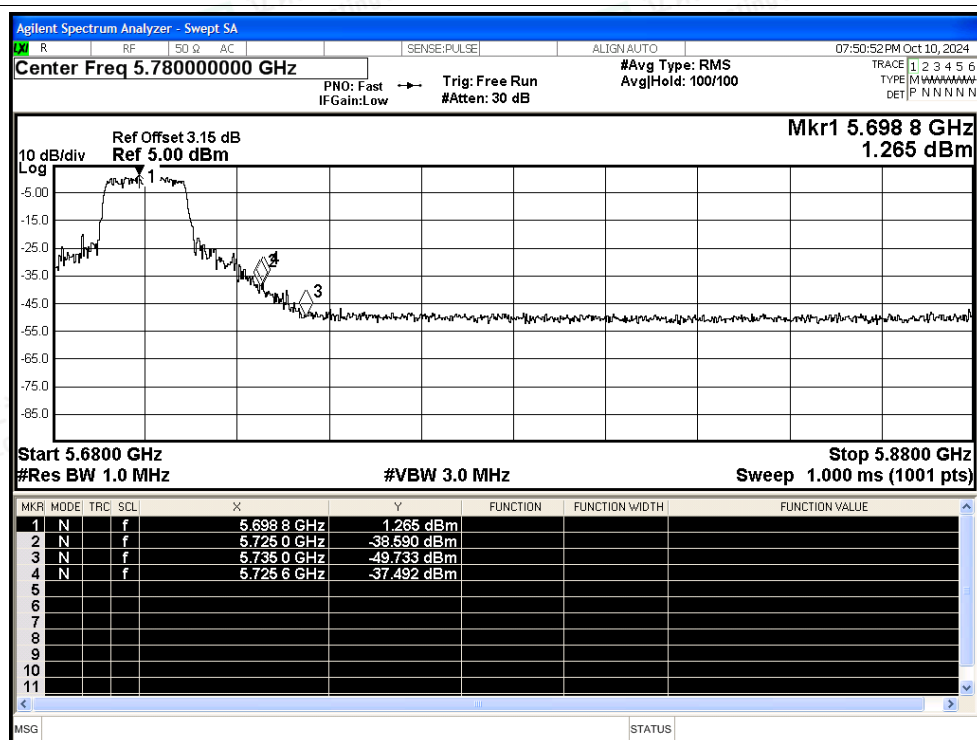


Restrict Band NVNT ac20 5700MHz Ant2 Average

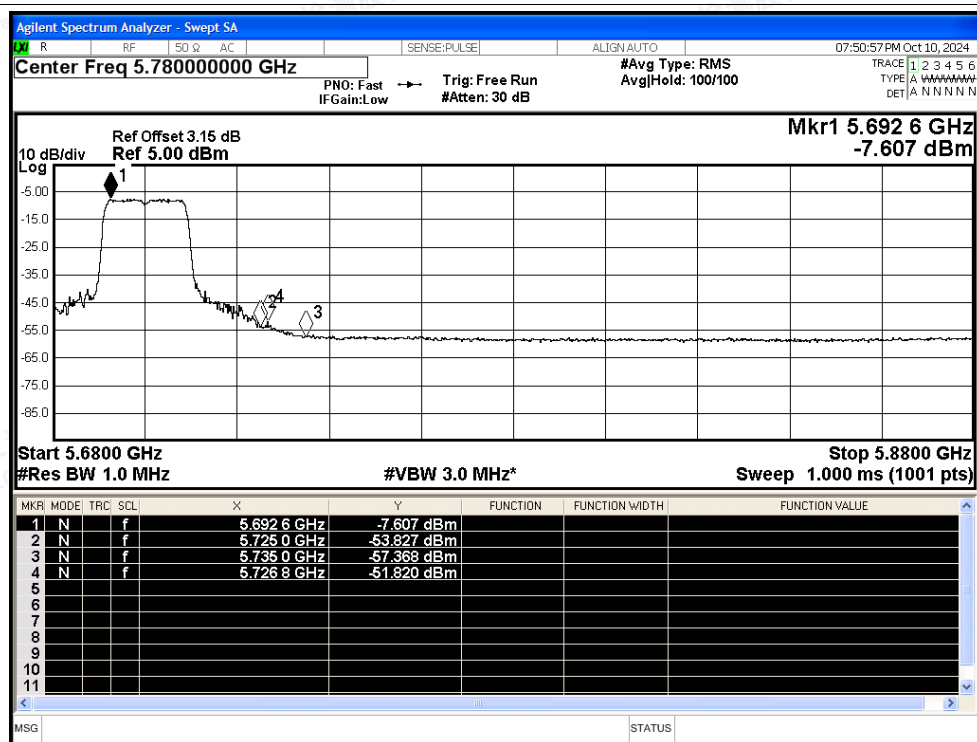




Restrict Band NVNT ac40 5510MHz Ant2 Peak

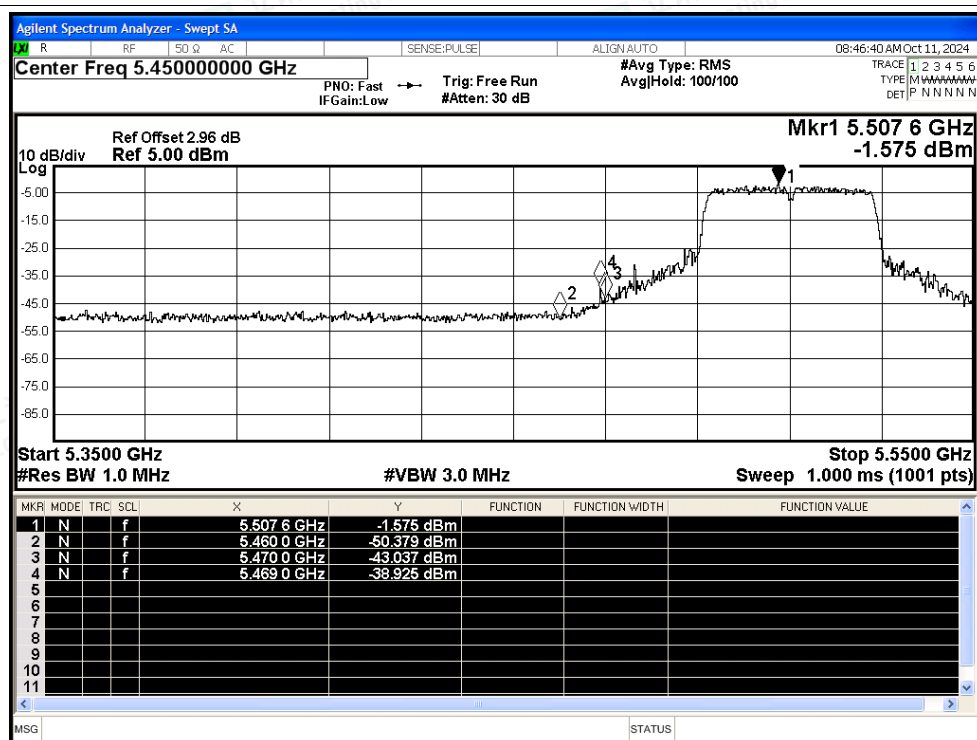


Restrict Band NVNT ac40 5510MHz Ant2 Average

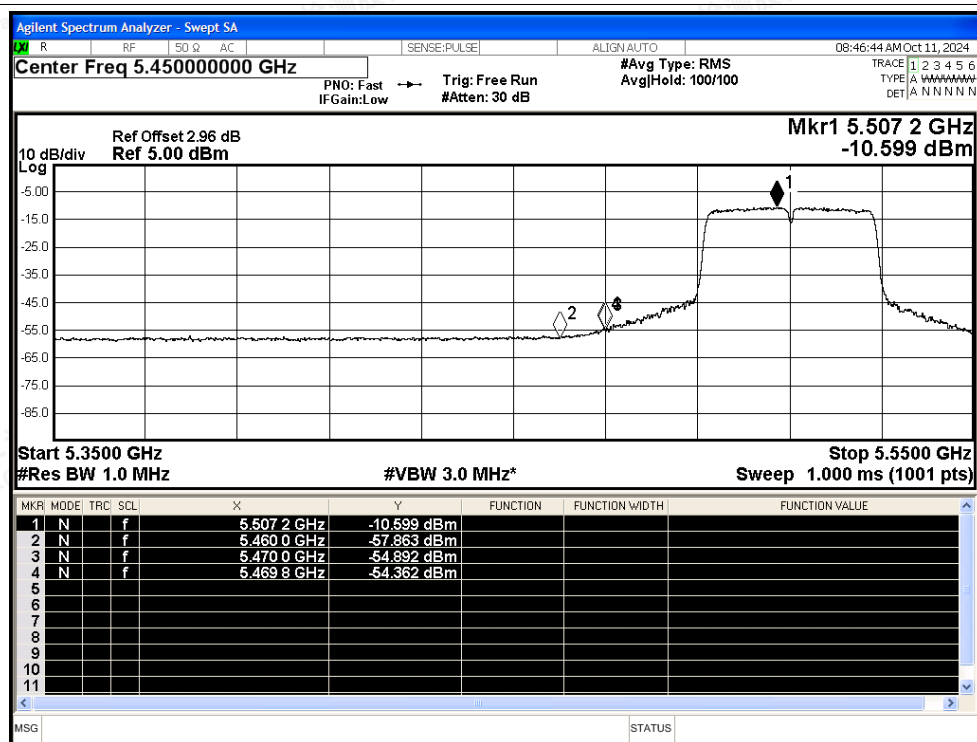




Restrict Band NVNT ac40 5670MHz Ant2 Peak

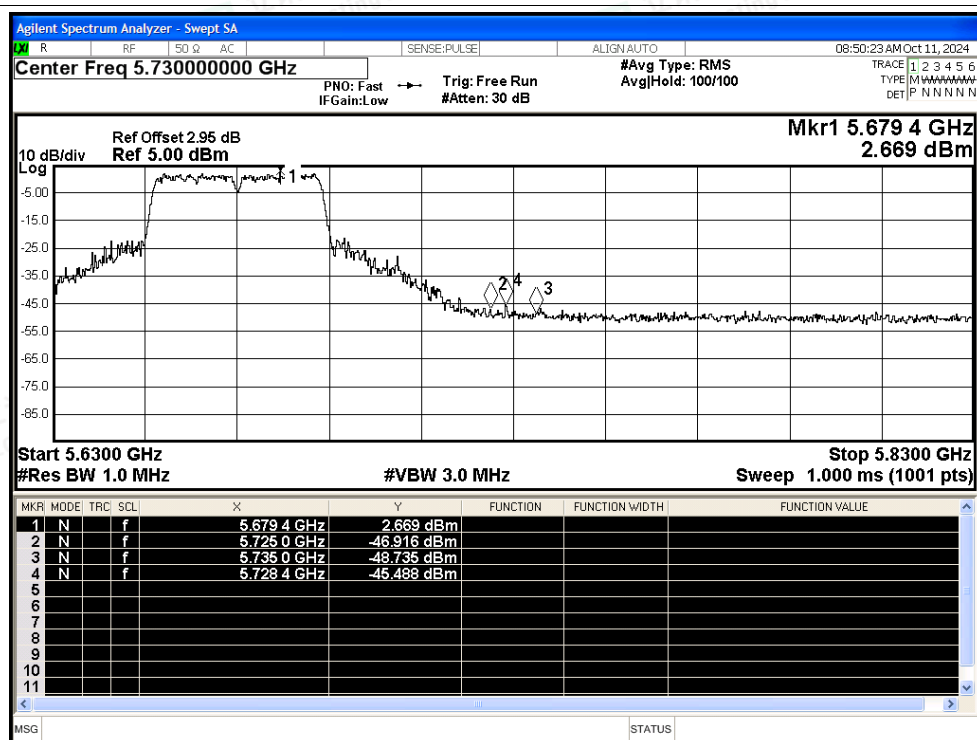


Restrict Band NVNT ac40 5670MHz Ant2 Average

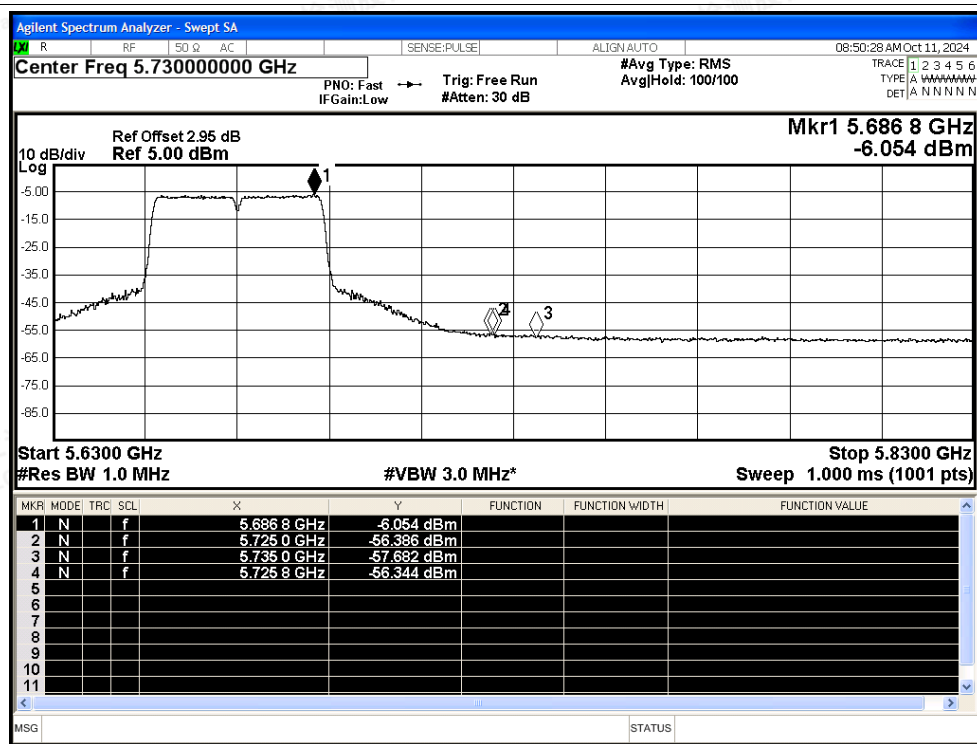




Restrict Band NVNT ac80 5530MHz Ant2 Peak

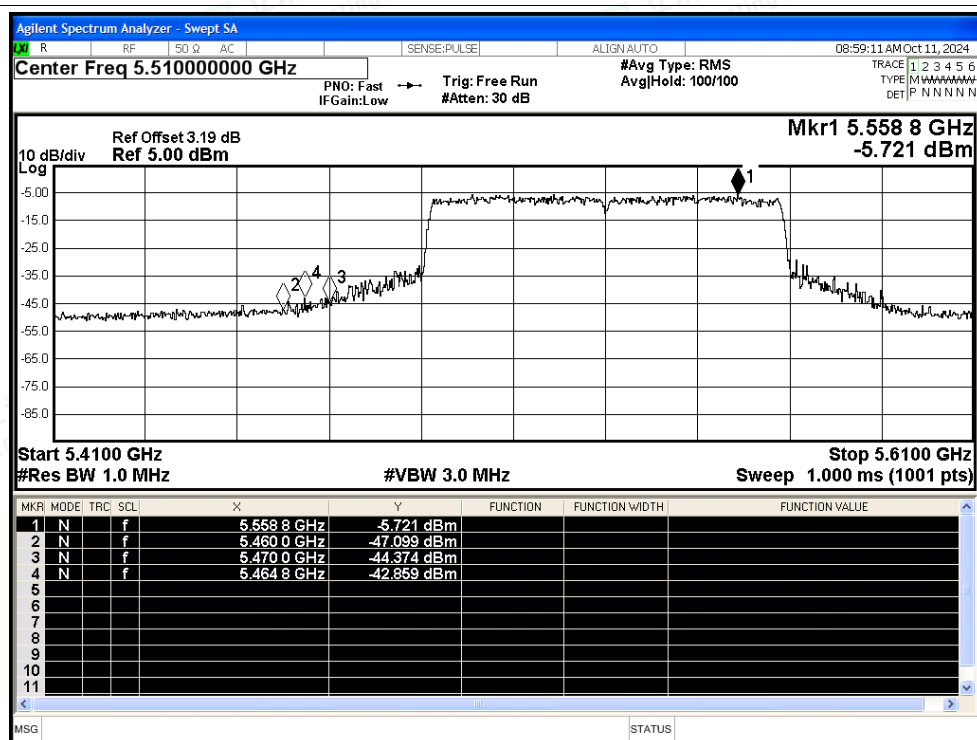


Restrict Band NVNT ac80 5530MHz Ant2 Average

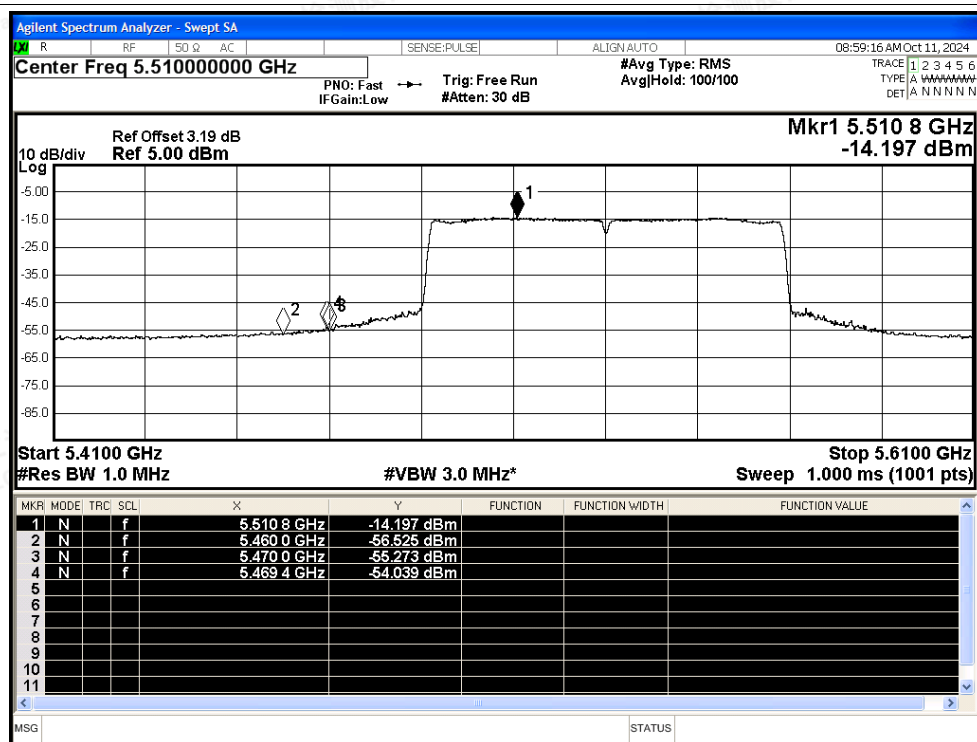




Restrict Band NVNT ac80 5610MHz Ant2 Peak

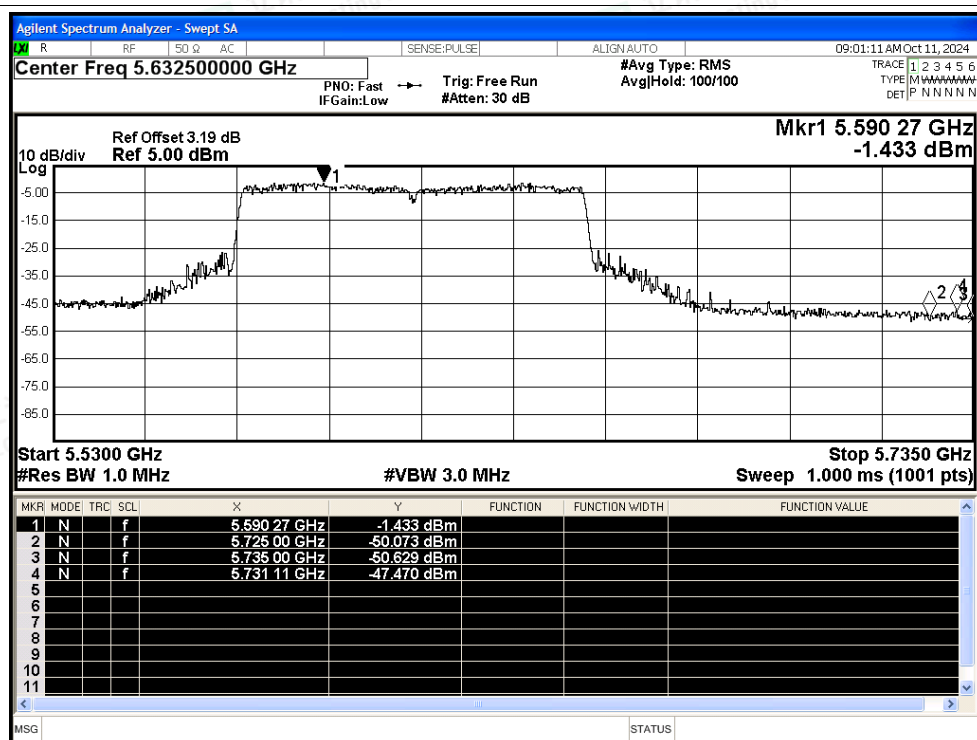


Restrict Band NVNT ac80 5610MHz Ant2 Average

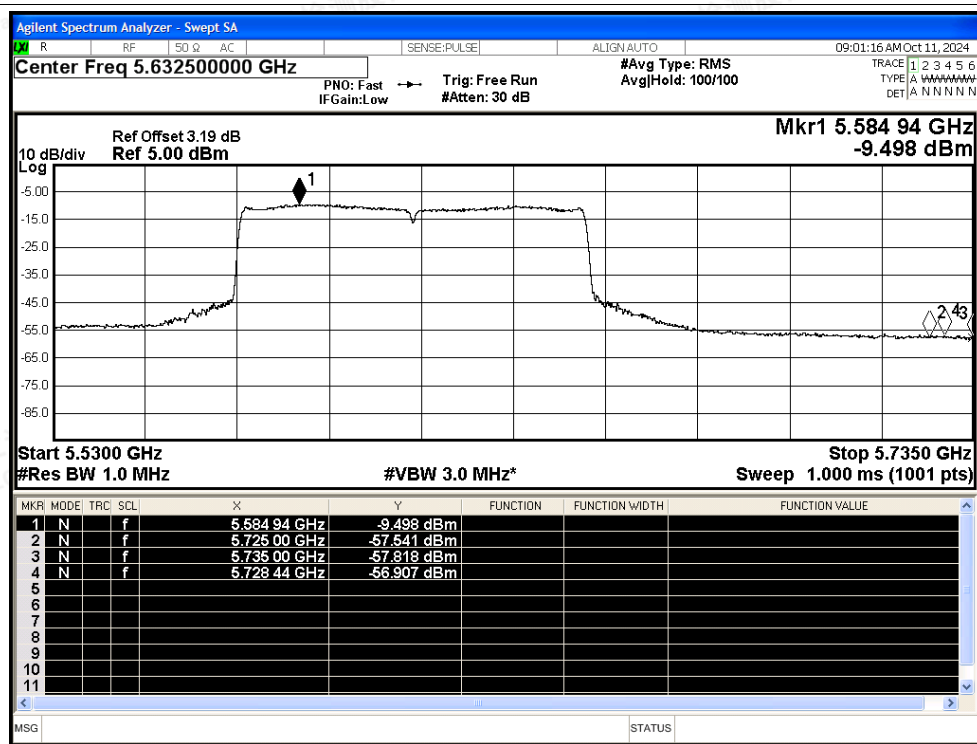




Restrict Band NVNT ac160 5570MHz Ant2 Peak

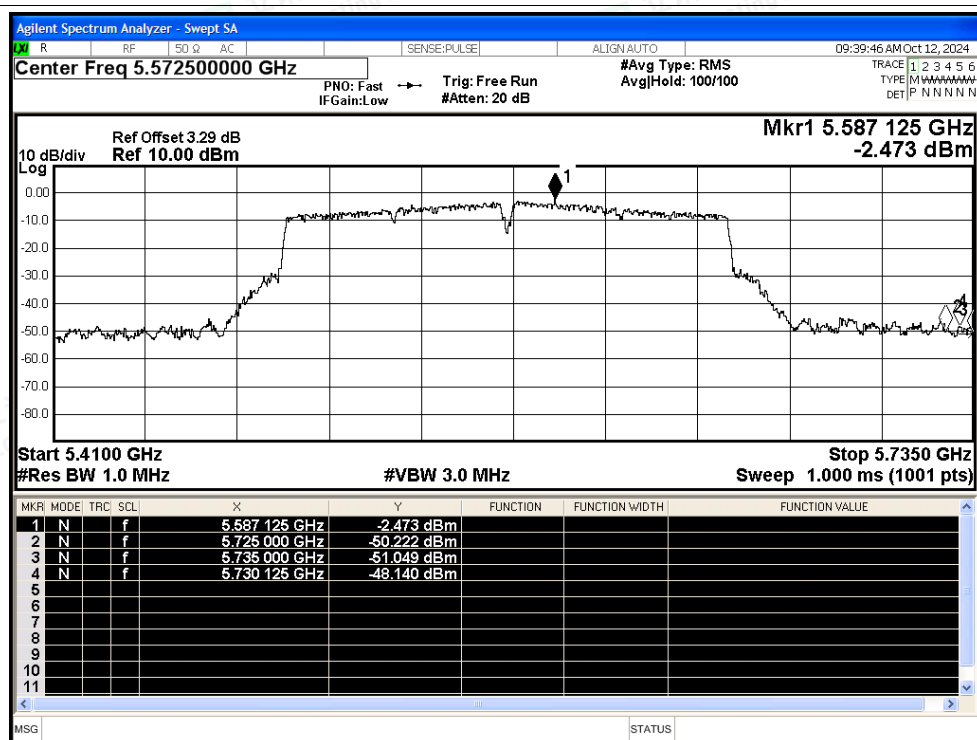


Restrict Band NVNT ac160 5570MHz Ant2 Average

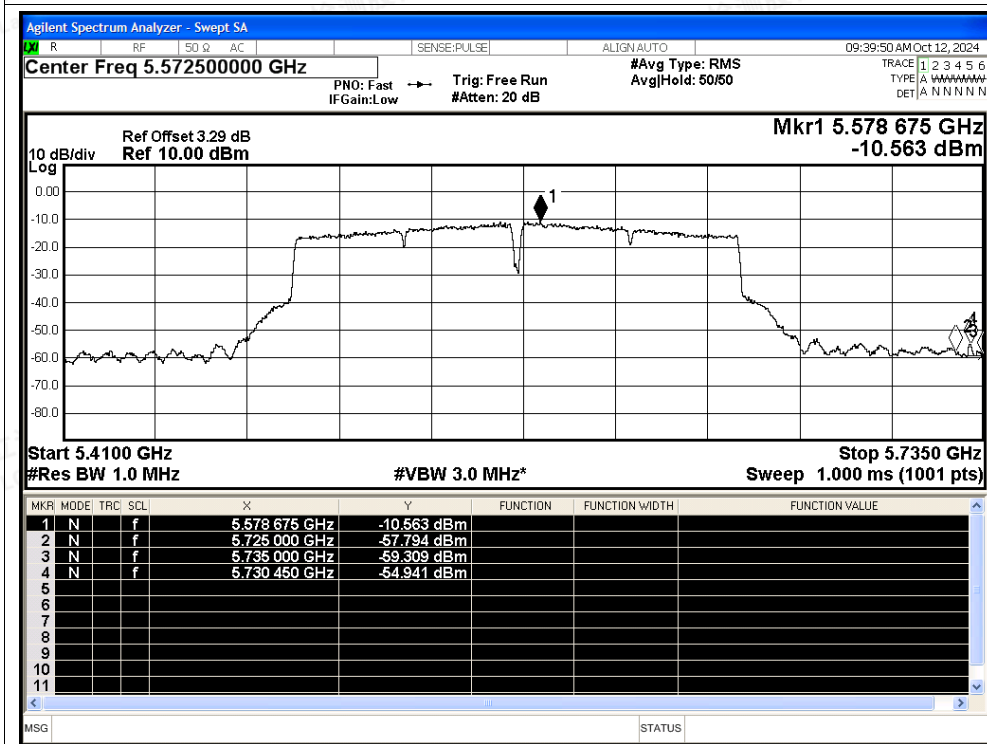




Restrict Band NVNT ac160 5570MHz Ant2 Peak

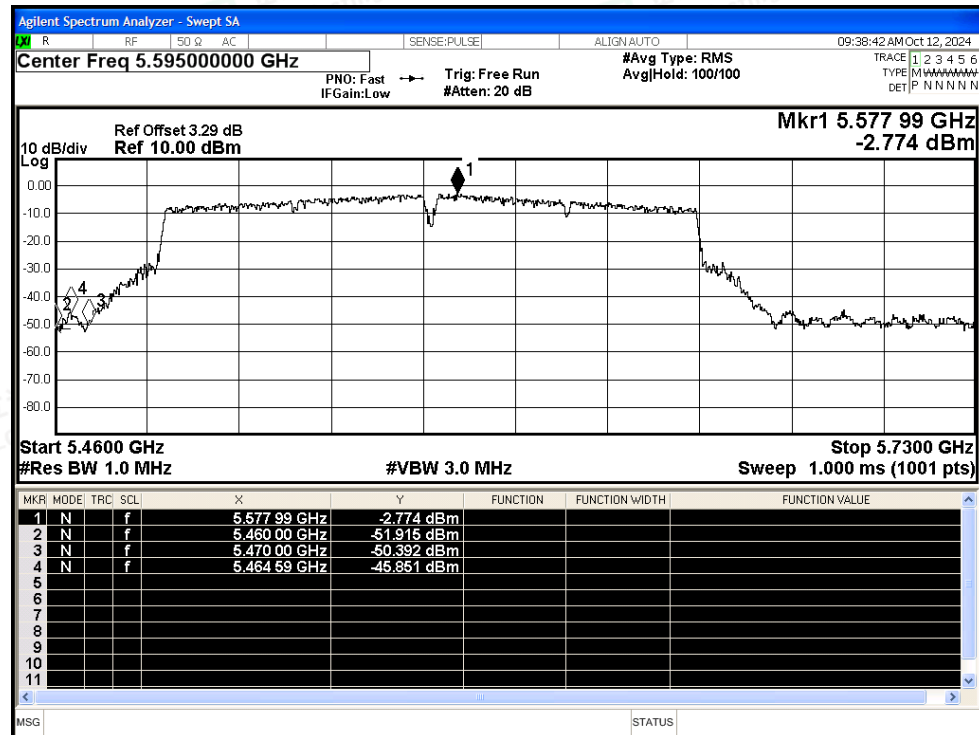


Restrict Band NVNT ac160 5570MHz Ant2 Average

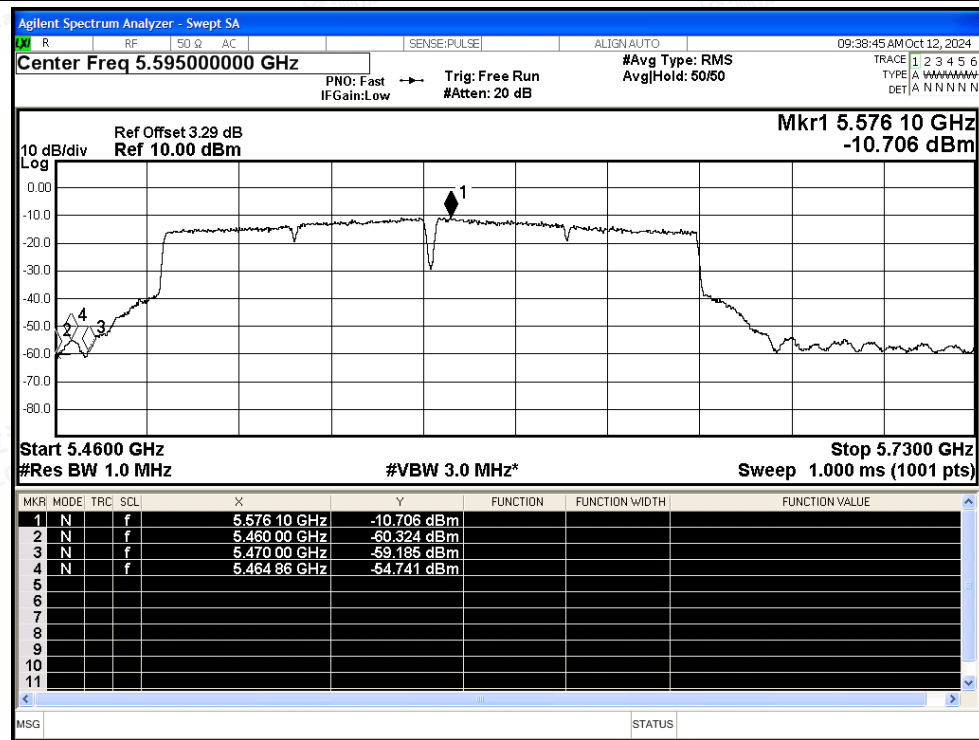




Restrict Band NVNT ax160 5570MHz Ant2 Peak

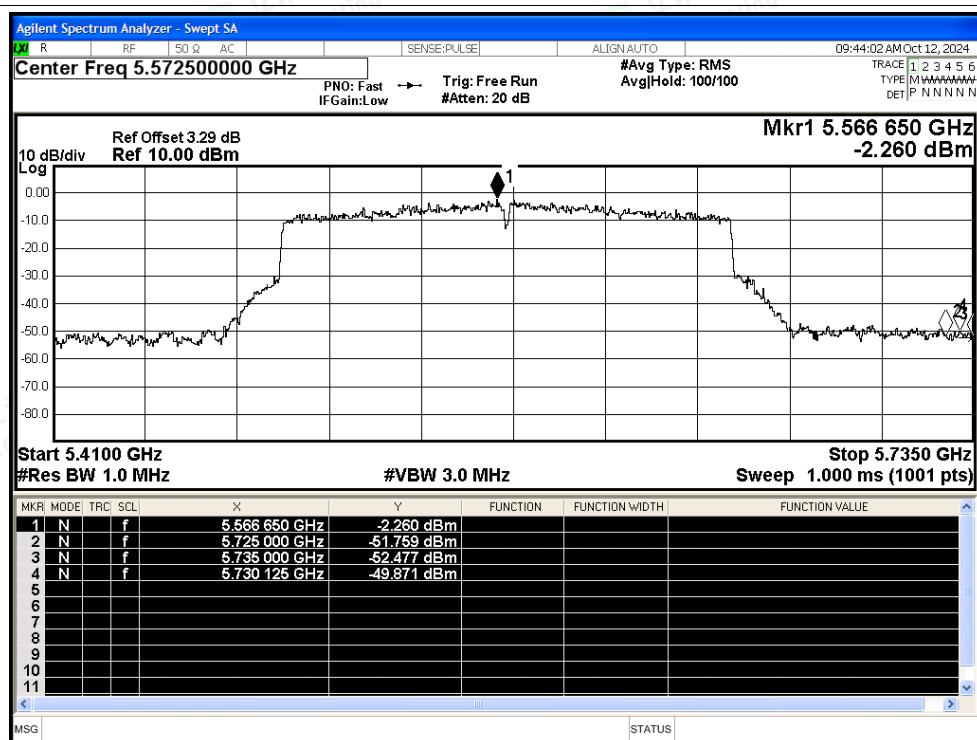


Restrict Band NVNT ax160 5570MHz Ant2 Average

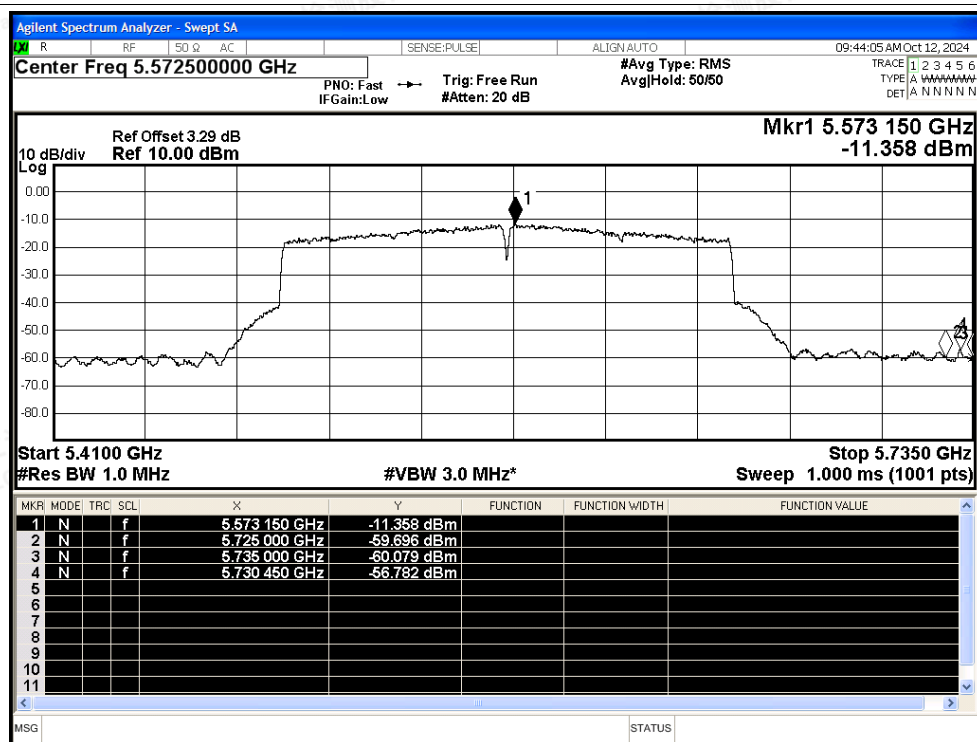






Restrict Band NVNT ax160 5570MHz Ant2 Peak

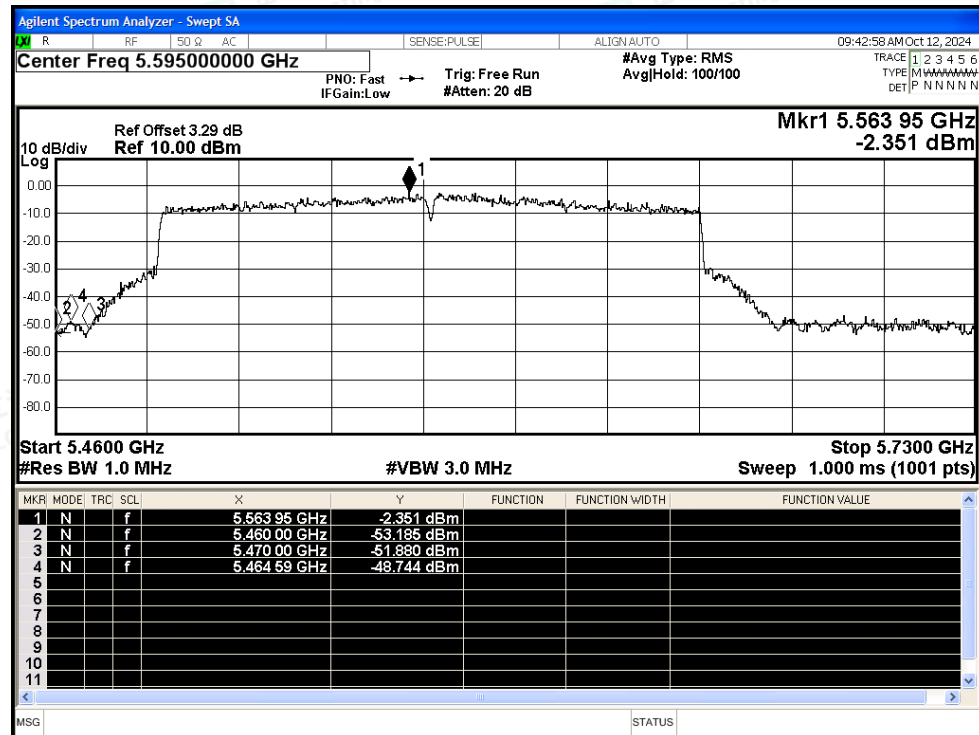


Restrict Band NVNT ax160 5570MHz Ant2 Average

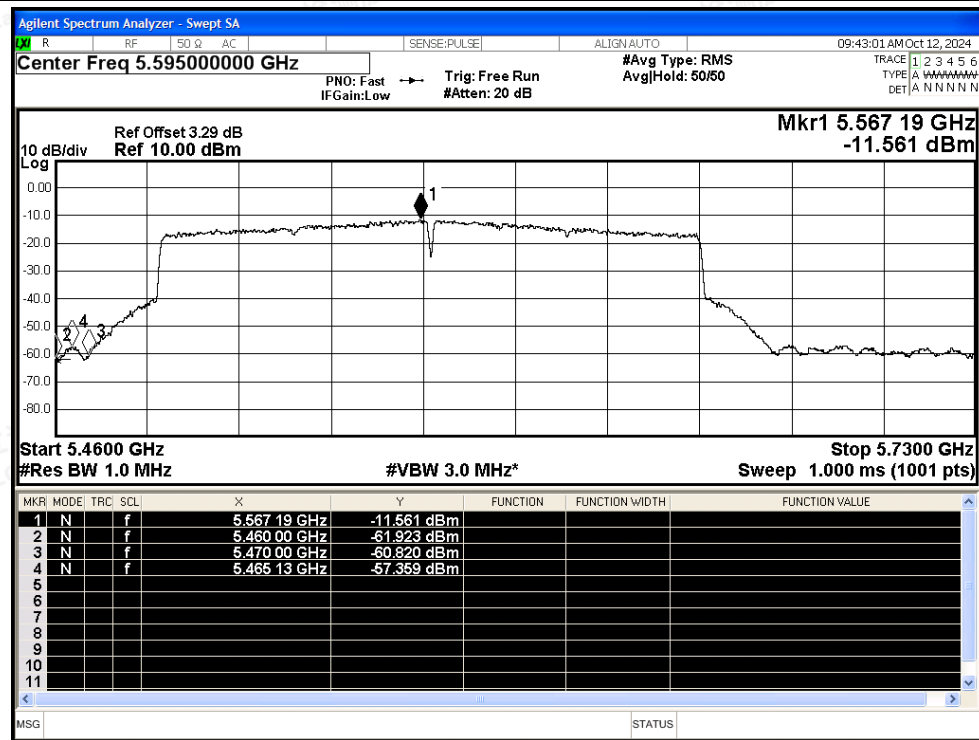

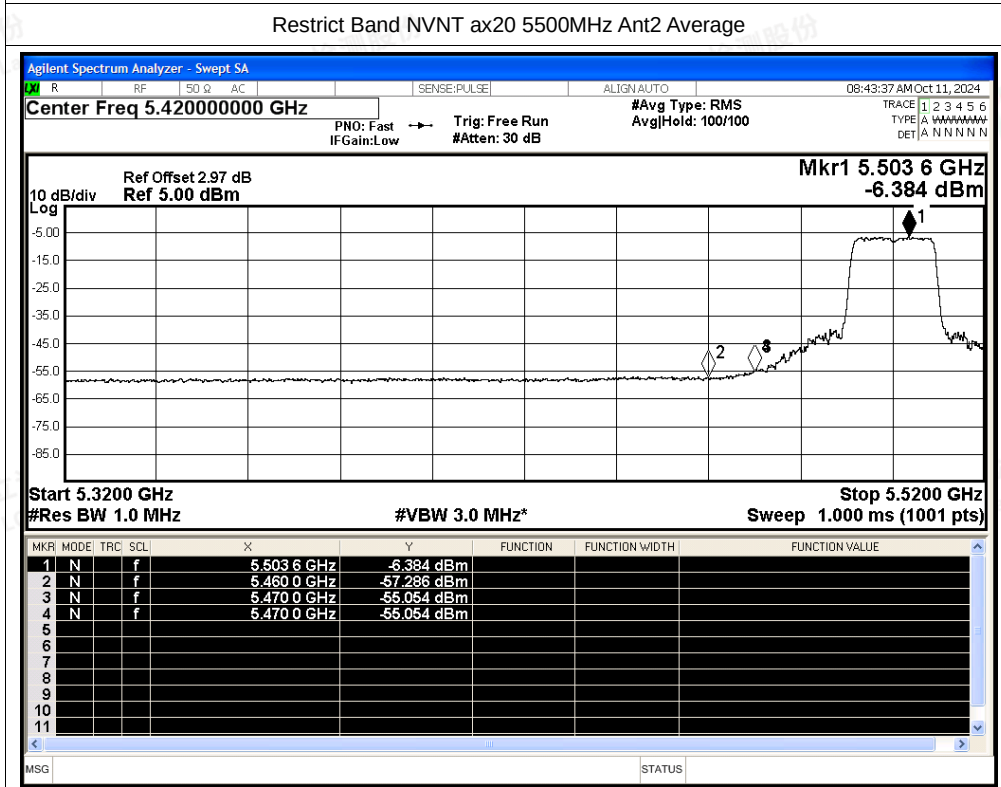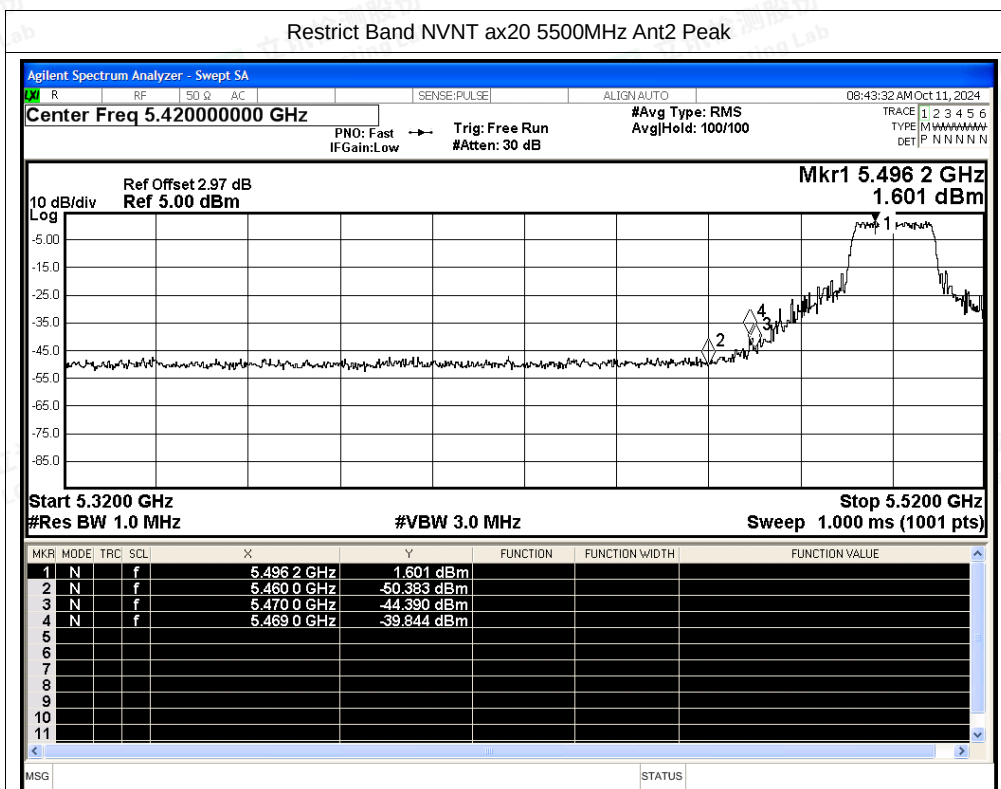




Restrict Band NVNT ax20 5700MHz Ant2 Peak

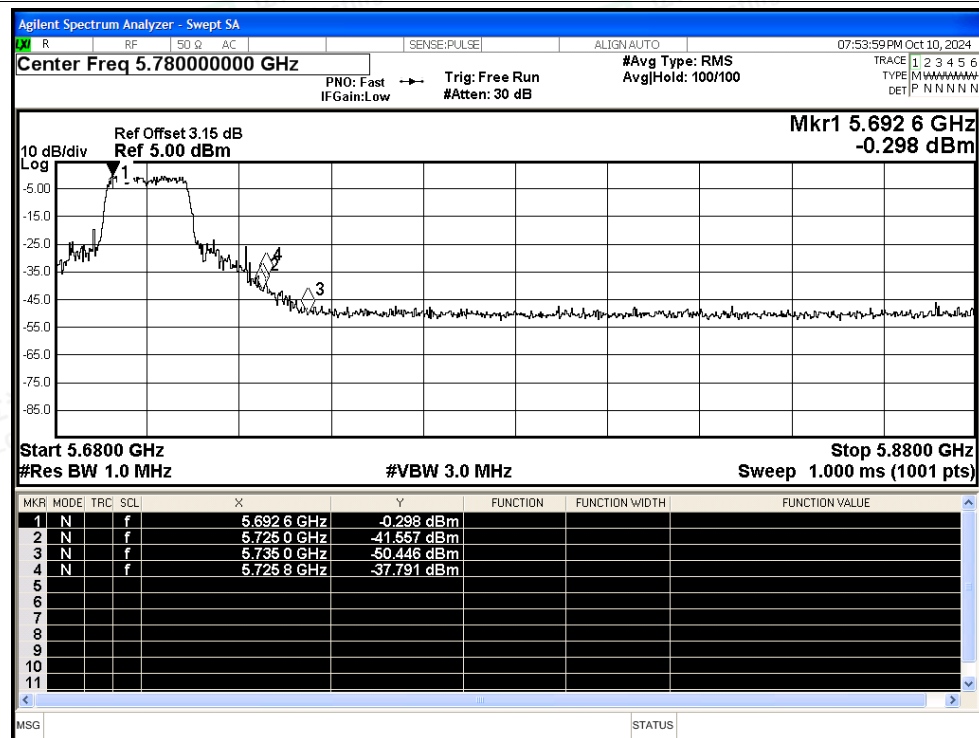


Restrict Band NVNT ax20 5700MHz Ant2 Average

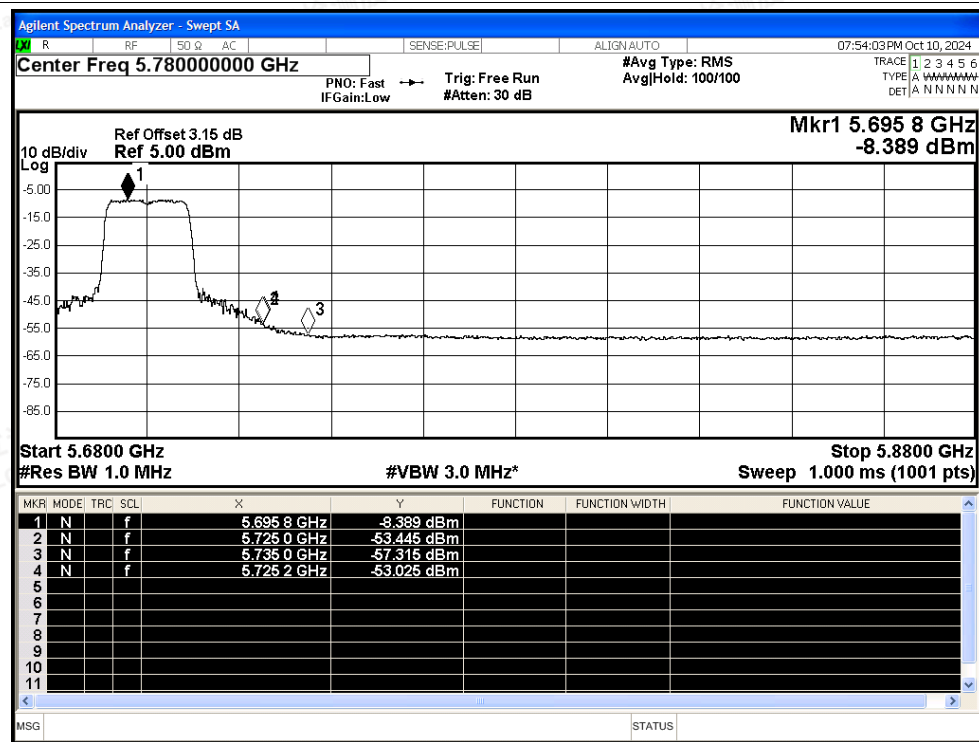




Restrict Band NVNT ax40 5510MHz Ant2 Peak

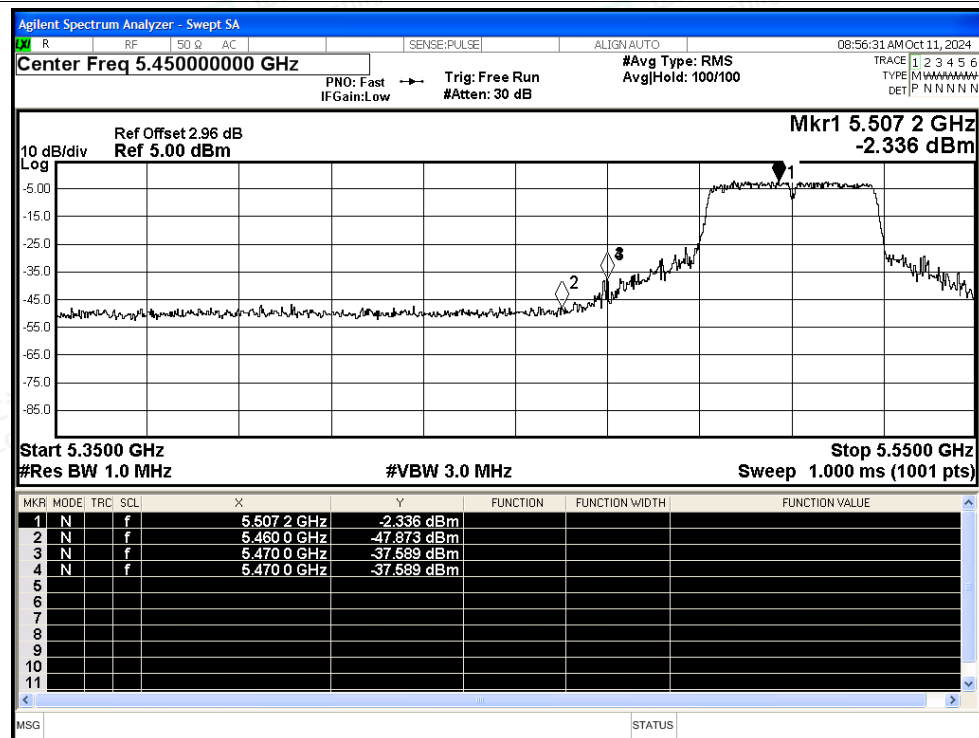


Restrict Band NVNT ax40 5510MHz Ant2 Average

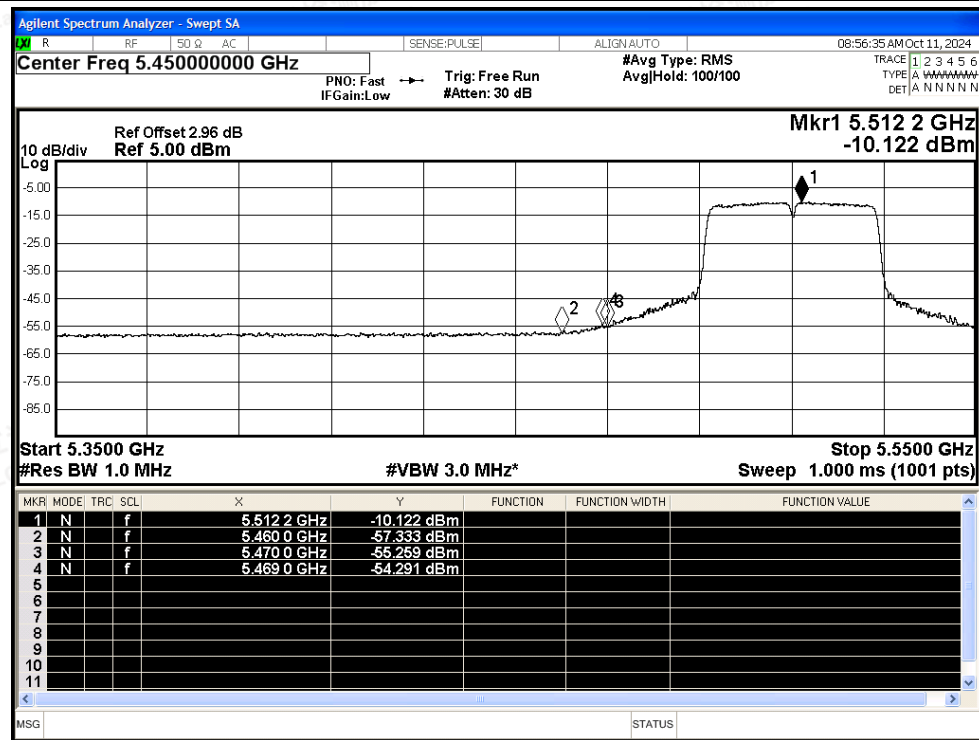




Restrict Band NVNT ax40 5670MHz Ant2 Peak

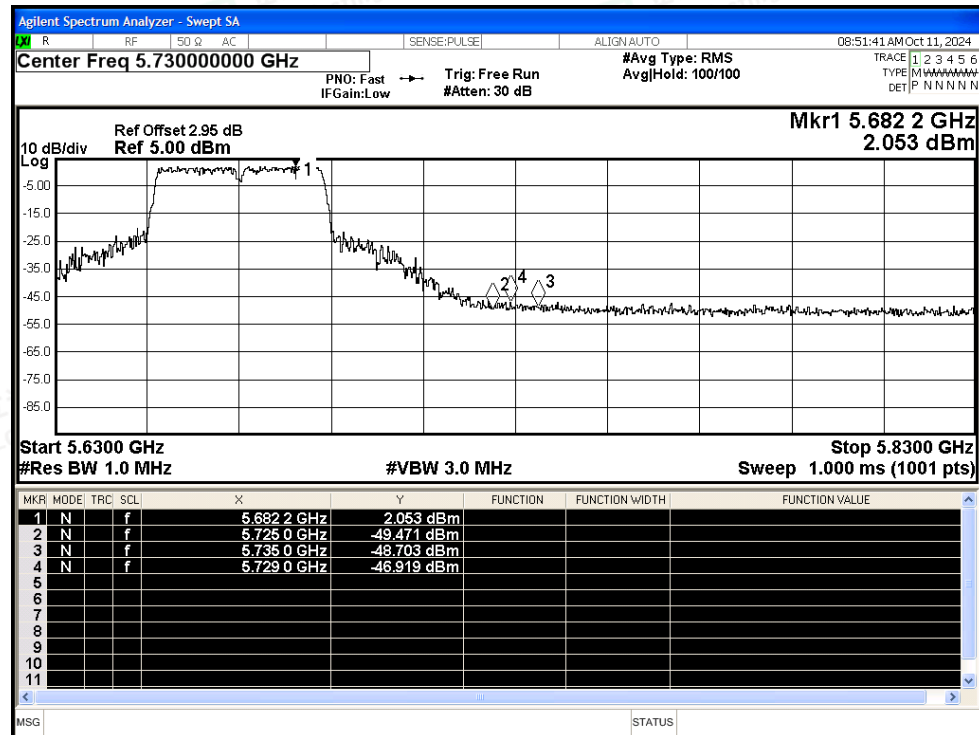


Restrict Band NVNT ax40 5670MHz Ant2 Average

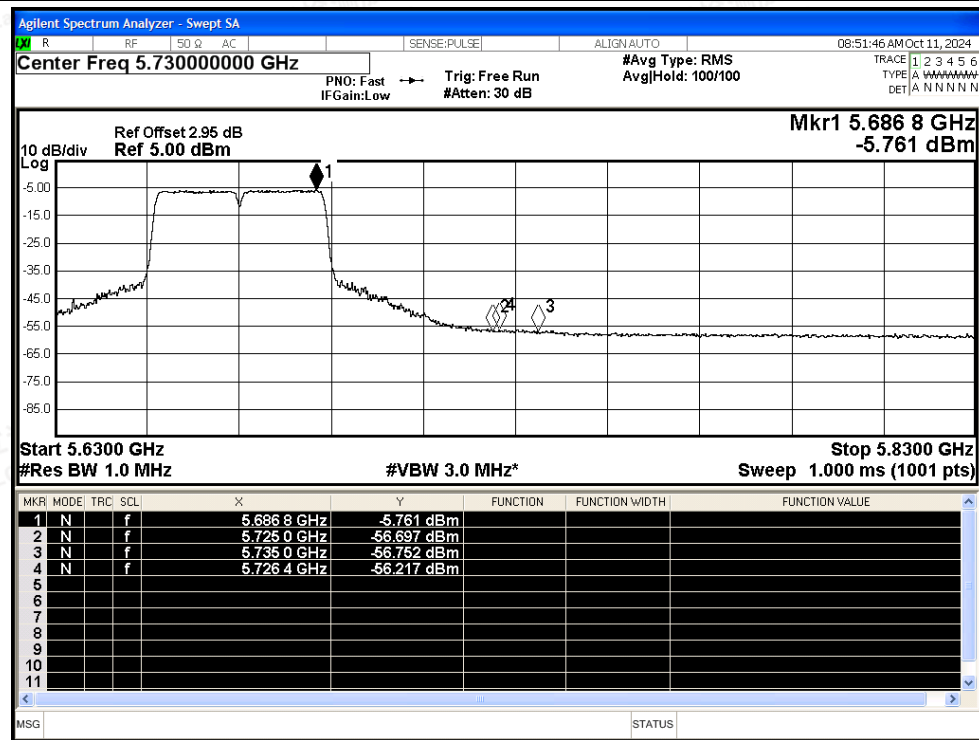




Restrict Band NVNT ax80 5530MHz Ant2 Peak

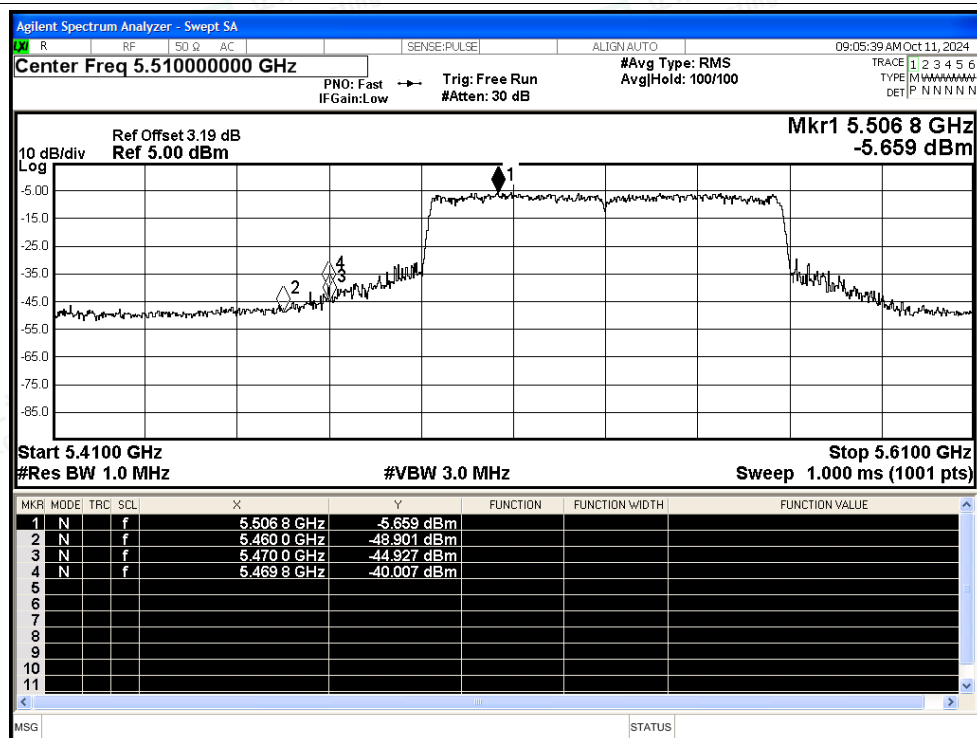


Restrict Band NVNT ax80 5530MHz Ant2 Average

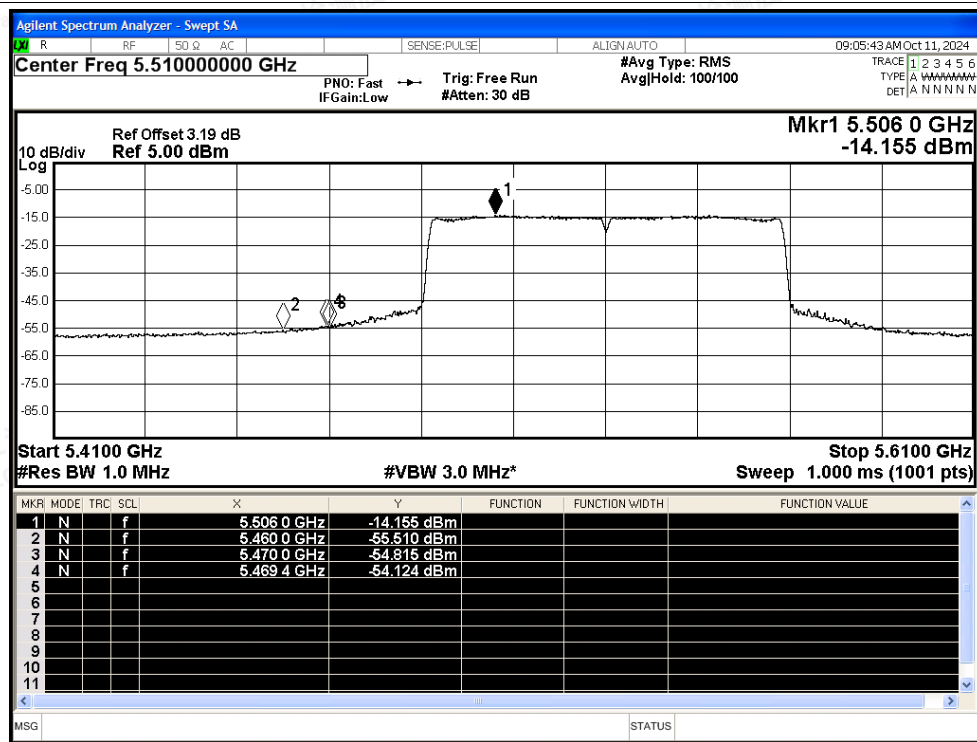




Restrict Band NVNT ax80 5610MHz Ant2 Peak

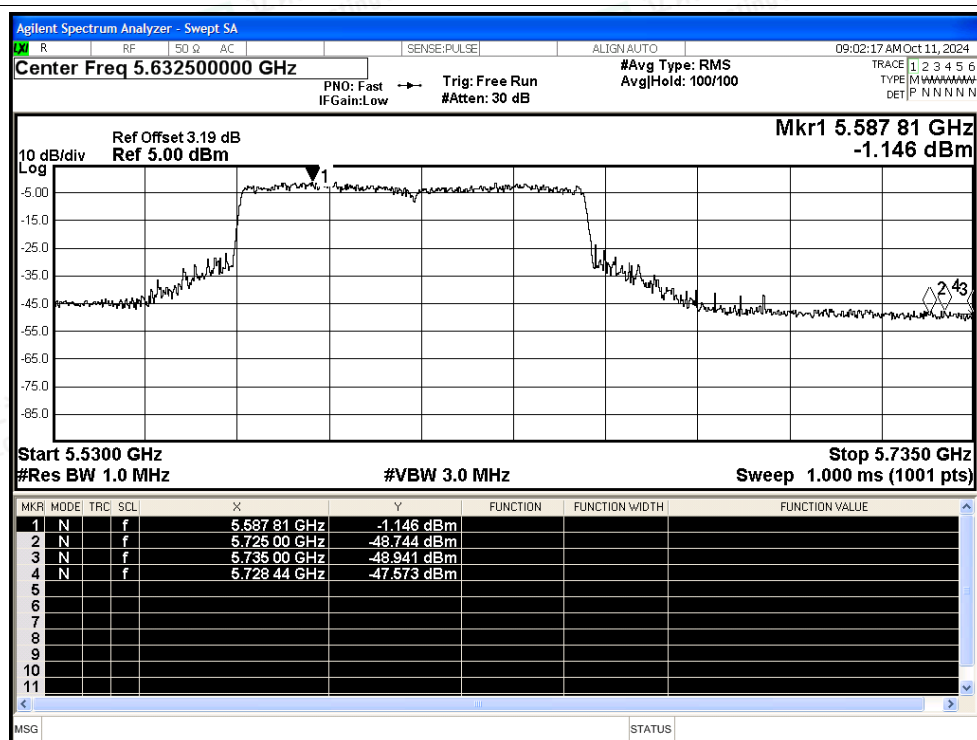

Restrict Band NVNT ax80 5610MHz Ant2 Average

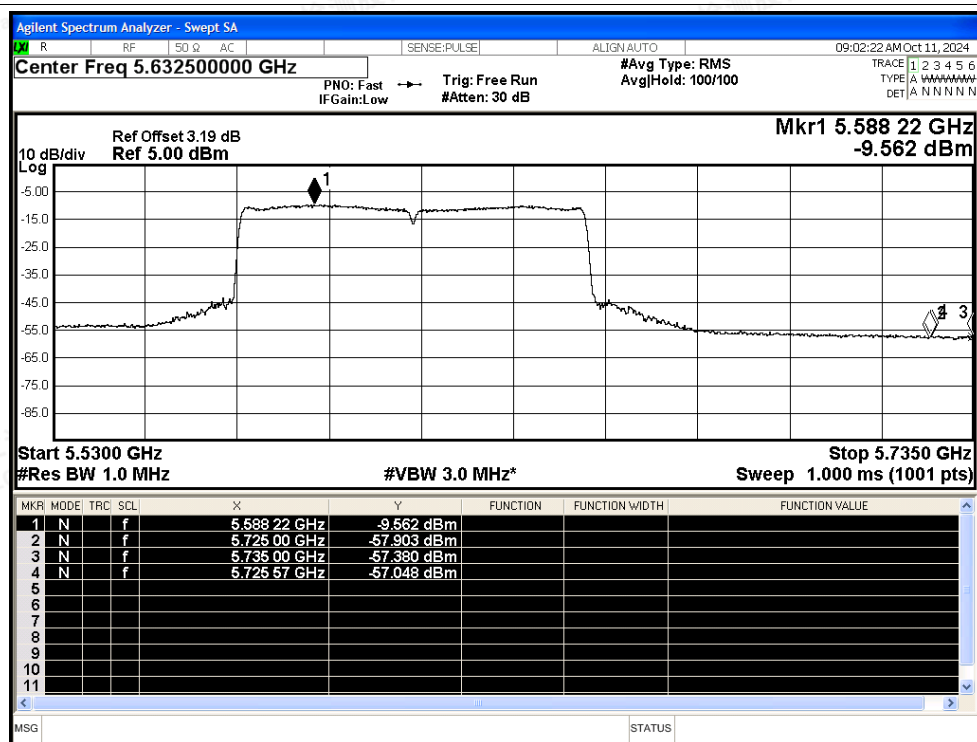



Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	Ant0 Power (dBm)	Ant1 Power (dBm)	Ant2 Power (dBm)	Ant0+ Ant1+ Ant2	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-48.74	-49.52	-48.93	-44.28	7.86	58.81	Peak	68.2	Pass
NVNT	n20	5500	5460	-58.03	-57.85	-57.12	-52.88	7.86	50.21	Average	54	Pass
NVNT	n20	5500	5470	-40.14	-39.54	-43.58	-35.99	7.86	67.10	Peak	68.2	Pass
NVNT	n20	5500	5469.8	-53.67	-56.01	-55.41	-50.14	7.86	52.95	Average	54	Pass
NVNT	n20	5500	5470	-45.97	-45.72	-43.58	-40.18	7.86	62.91	Peak	68.2	Pass
NVNT	n20	5500	5470	-53.67	-57.23	-55.73	-50.53	7.86	52.56	Average	54	Pass
NVNT	n20	5700	5725	-44.48	-38.03	-40.91	-35.62	7.86	67.47	Peak	68.2	Pass
NVNT	n20	5700	5725	-54.9	-54.42	-53.48	-49.45	7.86	53.63	Average	54	Pass
NVNT	n20	5700	5726.6	-39.67	-35.57	-37.88	-32.61	7.86	67.48	Peak	68.2	Pass
NVNT	n20	5700	5725.2	-54.86	-52.71	-53.48	-48.82	7.86	53.26	Average	54	Pass
NVNT	n20	5700	5735	-49.93	-48.93	-47.65	-43.96	7.86	59.12	Peak	68.2	Pass
NVNT	n20	5700	5735	-57.1	-57.71	-58.11	-52.85	7.86	50.24	Average	54	Pass
NVNT	n40	5510	5460	-51.16	-48.73	-49.61	-44.95	7.86	58.14	Peak	68.2	Pass
NVNT	n40	5510	5460	-58.25	-57.2	-57.74	-52.94	7.86	50.15	Average	54	Pass
NVNT	n40	5510	5469.8	-45.06	-40.32	-42.61	-37.47	7.86	65.61	Peak	68.2	Pass
NVNT	n40	5510	5469.6	-56.49	-54.28	-54.27	-50.12	7.86	52.96	Average	54	Pass
NVNT	n40	5510	5470	-48.03	-46.94	-43.05	-40.68	7.86	62.41	Peak	68.2	Pass
NVNT	n40	5510	5470	-56.81	-54.88	-54.71	-50.60	7.86	52.49	Average	54	Pass
NVNT	n40	5670	5725	-47.01	-45.4	-50.03	-42.32	7.86	60.77	Peak	68.2	Pass
NVNT	n40	5670	5725	-56.37	-55.21	-57.5	-51.49	7.86	51.60	Average	54	Pass
NVNT	n40	5670	5727.6	-46.25	-49.18	-47.68	-42.77	7.86	60.32	Peak	68.2	Pass
NVNT	n40	5670	5725.2	-55.09	-56.96	-56.7	-51.40	7.86	51.69	Average	54	Pass
NVNT	n40	5670	5735	-48.52	-49.18	-49.86	-44.38	7.86	58.71	Peak	68.2	Pass
NVNT	n40	5670	5735	-56.54	-56.96	-57.74	-52.28	7.86	50.81	Average	54	Pass
NVNT	ac20	5500	5460	-48.56	-49.24	-49.66	-44.36	7.86	58.73	Peak	68.2	Pass
NVNT	ac20	5500	5460	-57.83	-57.22	-57.56	-52.76	7.86	50.33	Average	54	Pass
NVNT	ac20	5500	5467	-41.16	-41.13	-42.45	-36.77	7.86	66.32	Peak	68.2	Pass
NVNT	ac20	5500	5469.4	-55.79	-55.18	-55.05	-50.56	7.86	52.53	Average	54	Pass
NVNT	ac20	5500	5470	-45.32	-46.6	-42.46	-39.67	7.86	63.42	Peak	68.2	Pass
NVNT	ac20	5500	5470	-56.96	-55.39	-55.82	-51.24	7.86	51.85	Average	54	Pass
NVNT	ac20	5700	5725	-41.04	-42.71	-38.59	-35.68	7.86	67.41	Peak	68.2	Pass
NVNT	ac20	5700	5725	-56.16	-53.95	-53.83	-49.75	7.86	53.34	Average	54	Pass
NVNT	ac20	5700	5725	-41.04	-38.51	-37.49	-34.00	7.86	67.09	Peak	68.2	Pass
NVNT	ac20	5700	5725.8	-54.96	-53.95	-51.82	-48.60	7.86	53.48	Average	54	Pass
NVNT	ac20	5700	5735	-49.71	-49.27	-49.73	-44.79	7.86	58.29	Peak	68.2	Pass
NVNT	ac20	5700	5735	-58.26	-57.75	-57.37	-53.01	7.86	50.08	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ac40	5510	5460	-50.08	-49.14	-50.38	-45.06	7.86	58.03	Peak	68.2	Pass
NVNT	ac40	5510	5460	-57.44	-57.59	-57.86	-52.86	7.86	50.23	Average	54	Pass
NVNT	ac40	5510	5469	-37.78	-39.53	-38.92	-33.91	7.86	68.18	Peak	68.2	Pass
NVNT	ac40	5510	5469.8	-54.06	-54.03	-54.36	-49.38	7.86	53.71	Average	54	Pass
NVNT	ac40	5510	5470	-42.92	-44.81	-43.04	-38.74	7.86	64.35	Peak	68.2	Pass
NVNT	ac40	5510	5470	-54.09	-54.03	-54.89	-49.55	7.86	53.54	Average	54	Pass
NVNT	ac40	5670	5725	-48.03	-48.95	-46.92	-43.12	7.86	59.97	Peak	68.2	Pass
NVNT	ac40	5670	5725	-55.23	-55.79	-56.39	-51.01	7.86	52.08	Average	54	Pass
NVNT	ac40	5670	5728.4	-46.14	-44.53	-45.49	-40.56	7.86	62.53	Peak	68.2	Pass
NVNT	ac40	5670	5725.8	-55.08	-55.76	-56.34	-50.92	7.86	52.17	Average	54	Pass
NVNT	ac40	5670	5735	-48.48	-48.28	-48.74	-43.72	7.86	59.37	Peak	68.2	Pass
NVNT	ac40	5670	5735	-56.83	-57.23	-57.68	-52.46	7.86	50.63	Average	54	Pass
NVNT	ac80	5530	5460	-48.07	-45.99	-47.1	-42.20	7.86	60.89	Peak	68.2	Pass
NVNT	ac80	5530	5460	-55.79	-55.36	-56.53	-51.10	7.86	51.99	Average	54	Pass
NVNT	ac80	5530	5464.8	-41.55	-40.77	-42.86	-36.87	7.86	66.22	Peak	68.2	Pass
NVNT	ac80	5530	5469.4	-53.83	-53.39	-54.04	-48.97	7.86	53.12	Average	54	Pass
NVNT	ac80	5530	5470	-46.07	-40.77	-44.37	-38.39	7.86	64.70	Peak	68.2	Pass
NVNT	ac80	5530	5470	-55.12	-53.87	-55.27	-49.94	7.86	53.15	Average	54	Pass
NVNT	ac80	5610	5725	-47.84	-48.52	-50.07	-43.94	7.86	59.15	Peak	68.2	Pass
NVNT	ac80	5610	5725	-56.91	-56.97	-57.54	-52.36	7.86	50.73	Average	54	Pass
NVNT	ac80	5610	5731.105	-47.01	-45.85	-47.47	-41.95	7.86	61.14	Peak	68.2	Pass
NVNT	ac80	5610	5728.44	-56.26	-56.78	-56.91	-51.87	7.86	51.22	Average	54	Pass
NVNT	ac80	5610	5735	-49.57	-49.25	-50.63	-45.01	7.86	58.08	Peak	68.2	Pass
NVNT	ac80	5610	5735	-57.14	-57.27	-57.82	-52.63	7.86	50.46	Average	54	Pass
NVNT	ac160	5570	5725	-48.08	-49.95	-50.22	-44.54	7.86	58.55	Peak	68.2	Pass
NVNT	ac160	5570	5725	-57.3	-58.28	-57.79	-53.00	7.86	50.09	Average	54	Pass
NVNT	ac160	5570	5730.125	-47.04	-47.96	-48.14	-42.91	7.86	60.18	Peak	68.2	Pass
NVNT	ac160	5570	5730.45	-53.68	-54.7	-54.94	-49.63	7.86	53.46	Average	54	Pass
NVNT	ac160	5570	5735	-50.11	-48.87	-51.05	-45.15	7.86	57.94	Peak	68.2	Pass
NVNT	ac160	5570	5735	-58.17	-58.84	-59.31	-53.98	7.86	49.11	Average	54	Pass
NVNT	ac160	5570	5460	-51.26	-50.28	-51.92	-46.33	7.86	56.76	Peak	68.2	Pass
NVNT	ac160	5570	5460	-59.25	-60.29	-60.32	-55.15	7.86	47.94	Average	54	Pass
NVNT	ac160	5570	5464.59	-44.85	-47.13	-45.85	-41.07	7.86	62.02	Peak	68.2	Pass
NVNT	ac160	5570	5464.86	-53.84	-54.19	-54.74	-49.47	7.86	53.62	Average	54	Pass
NVNT	ac160	5570	5470	-49.03	-50.63	-50.39	-45.19	7.86	57.90	Peak	68.2	Pass
NVNT	ac160	5570	5470	-57.87	-57.25	-59.19	-53.26	7.86	49.83	Average	54	Pass
NVNT	ax160	5570	5725	-48.75	-47.83	-51.76	-44.38	7.86	58.71	Peak	68.2	Pass
NVNT	ax160	5570	5725	-57.73	-57.55	-59.7	-53.45	7.86	49.64	Average	54	Pass
NVNT	ax160	5570	5730.125	-47.58	-46.81	-49.87	-43.13	7.86	59.96	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ax160	5570	5730.45	-54.48	-55.24	-56.78	-50.63	7.86	52.46	Average	54	Pass
NVNT	ax160	5570	5735	-51.13	-49.32	-52.48	-46.01	7.86	57.08	Peak	68.2	Pass
NVNT	ax160	5570	5735	-58.29	-58.55	-60.08	-54.13	7.86	48.96	Average	54	Pass
NVNT	ax160	5570	5460	-51.34	-51.91	-53.19	-47.31	7.86	55.78	Peak	68.2	Pass
NVNT	ax160	5570	5460	-59.77	-59.53	-61.92	-55.51	7.86	47.58	Average	54	Pass
NVNT	ax160	5570	5464.59	-45.84	-46.44	-48.74	-42.07	7.86	61.02	Peak	68.2	Pass
NVNT	ax160	5570	5465.13	-55.57	-55.37	-57.36	-51.24	7.86	51.85	Average	54	Pass
NVNT	ax160	5570	5470	-49.96	-50.37	-51.88	-45.89	7.86	57.20	Peak	68.2	Pass
NVNT	ax160	5570	5470	-58.2	-59.02	-60.82	-54.44	7.86	48.65	Average	54	Pass
NVNT	ax20	5500	5460	-49.04	-50.28	-50.38	-45.08	7.86	58.01	Peak	68.2	Pass
NVNT	ax20	5500	5460	-58.1	-57.81	-57.29	-52.95	7.86	50.14	Average	54	Pass
NVNT	ax20	5500	5469	-45.15	-41.48	-39.84	-36.87	7.86	66.22	Peak	68.2	Pass
NVNT	ax20	5500	5470	-55.85	-55.55	-55.05	-50.70	7.86	52.39	Average	54	Pass
NVNT	ax20	5500	5470	-45.54	-44.21	-44.39	-39.90	7.86	63.19	Peak	68.2	Pass
NVNT	ax20	5500	5470	-55.98	-56.18	-55.05	-50.94	7.86	52.15	Average	54	Pass
NVNT	ax20	5700	5725	-38.46	-43.75	-41.56	-35.94	7.86	67.15	Peak	68.2	Pass
NVNT	ax20	5700	5725	-54.04	-54.22	-53.45	-49.12	7.86	53.97	Average	54	Pass
NVNT	ax20	5700	5725.8	-38.46	-38.21	-37.79	-33.37	7.86	67.72	Peak	68.2	Pass
NVNT	ax20	5700	5725.2	-53.55	-54.22	-53.03	-48.80	7.86	54.29	Average	54	Pass
NVNT	ax20	5700	5735	-49.01	-50.35	-50.45	-45.11	7.86	57.98	Peak	68.2	Pass
NVNT	ax20	5700	5735	-57.39	-57.86	-57.32	-52.75	7.86	50.34	Average	54	Pass
NVNT	ax40	5510	5460	-49.16	-48.43	-47.87	-43.68	7.86	59.41	Peak	68.2	Pass
NVNT	ax40	5510	5460	-57.11	-57.68	-57.33	-52.60	7.86	50.49	Average	54	Pass
NVNT	ax40	5510	5470	-38.98	-41.3	-37.59	-34.26	7.86	67.83	Peak	68.2	Pass
NVNT	ax40	5510	5469	-54.15	-55.06	-54.29	-49.71	7.86	53.38	Average	54	Pass
NVNT	ax40	5510	5470	-41.73	-46.9	-37.59	-35.82	7.86	67.27	Peak	68.2	Pass
NVNT	ax40	5510	5470	-54.15	-55.58	-55.26	-50.18	7.86	52.91	Average	54	Pass
NVNT	ax40	5670	5725	-47.12	-46.86	-49.47	-42.90	7.86	60.19	Peak	68.2	Pass
NVNT	ax40	5670	5725	-56.07	-56.42	-56.7	-51.62	7.86	51.47	Average	54	Pass
NVNT	ax40	5670	5729	-46.69	-46.61	-46.92	-41.97	7.86	61.12	Peak	68.2	Pass
NVNT	ax40	5670	5726.4	-55.49	-55.52	-56.22	-50.96	7.86	52.13	Average	54	Pass
NVNT	ax40	5670	5735	-49.18	-48.83	-48.7	-44.13	7.86	58.96	Peak	68.2	Pass
NVNT	ax40	5670	5735	-57.07	-57.1	-56.75	-52.20	7.86	50.89	Average	54	Pass
NVNT	ax80	5530	5460	-49.84	-45.88	-48.9	-43.09	7.86	60.00	Peak	68.2	Pass
NVNT	ax80	5530	5460	-57.61	-55.77	-55.51	-51.43	7.86	51.66	Average	54	Pass
NVNT	ax80	5530	5468.2	-45	-42.13	-40.01	-37.15	7.86	65.93	Peak	68.2	Pass
NVNT	ax80	5530	5468.6	-55.84	-53.73	-54.12	-49.70	7.86	53.39	Average	54	Pass
NVNT	ax80	5530	5470	-49.16	-44.81	-44.93	-41.12	7.86	61.97	Peak	68.2	Pass
NVNT	ax80	5530	5470	-56.51	-53.73	-54.82	-50.10	7.86	52.98	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



NVNT	ax80	5610	5725	-50.32	-49.75	-48.74	-44.78	7.86	58.31	Peak	68.2	Pass
NVNT	ax80	5610	5725	-57.17	-56.75	-57.9	-52.48	7.86	50.61	Average	54	Pass
NVNT	ax80	5610	5728.44	-47.08	-46.97	-47.57	-42.43	7.86	60.66	Peak	68.2	Pass
NVNT	ax80	5610	5725.57	-56.31	-56.45	-57.05	-51.82	7.86	51.27	Average	54	Pass
NVNT	ax80	5610	5735	-48.45	-49.94	-48.94	-44.30	7.86	58.79	Peak	68.2	Pass
NVNT	ax80	5610	5735	-56.97	-57.51	-57.38	-52.51	7.86	50.58	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



D.5 Frequency Stability

Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant0	5500.02	20000	3.64	25	Pass
NVNT	a	5580	Ant0	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant0	5700	0	0	25	Pass
NVNT	n20	5500	Ant0	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant0	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant0	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant0	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant0	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant0	5670	0	0	25	Pass
NVNT	ac20	5500	Ant0	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant0	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant0	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant0	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant0	5549.96	-40000	-7.21	25	Pass
NVNT	ac40	5670	Ant0	5670	0	0	25	Pass
NVNT	ac80	5530	Ant0	5530	0	0	25	Pass
NVNT	ac80	5610	Ant0	5610	0	0	25	Pass
NVNT	ac160	5570	Ant0	5570	0	0	25	Pass
NVNT	ax160	5570	Ant0	5570	0	0	25	Pass
NVNT	ax20	5500	Ant0	5500	0	0	25	Pass
NVNT	ax20	5580	Ant0	5579.98	-20000	-3.58	25	Pass
NVNT	ax20	5700	Ant0	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant0	5510	0	0	25	Pass
NVNT	ax40	5550	Ant0	5549.96	-40000	-7.21	25	Pass
NVNT	ax40	5670	Ant0	5669.96	-40000	-7.05	25	Pass
NVNT	ax80	5530	Ant0	5530	0	0	25	Pass
NVNT	ax80	5610	Ant0	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant0

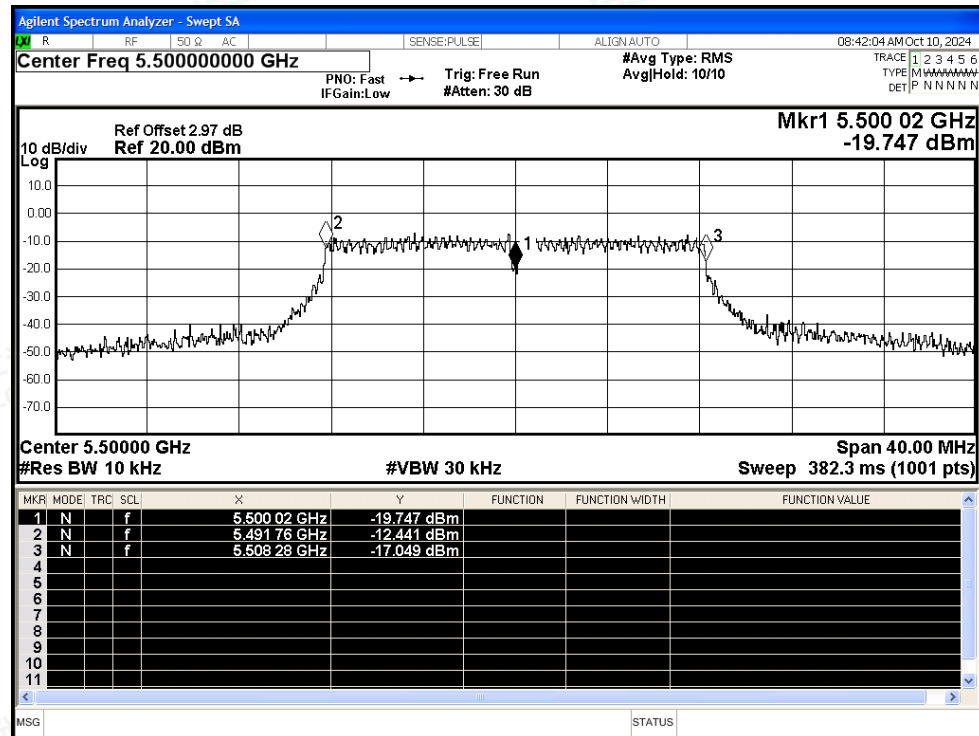


Freq. Stability NVNT a 5580MHz Ant0

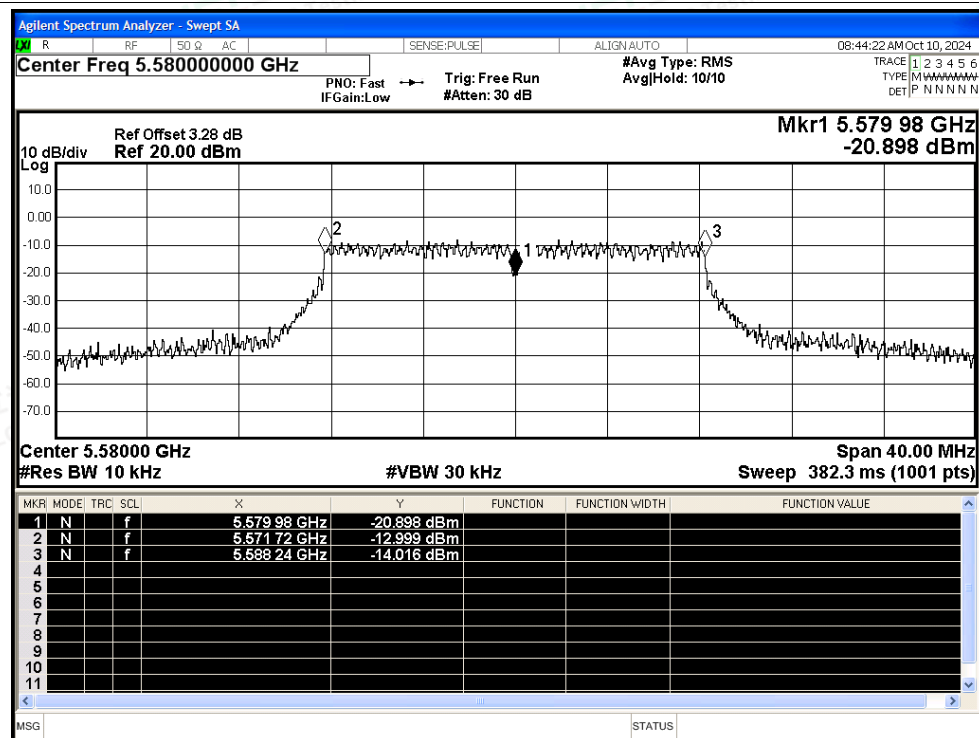




Freq. Stability NVNT a 5700MHz Ant0

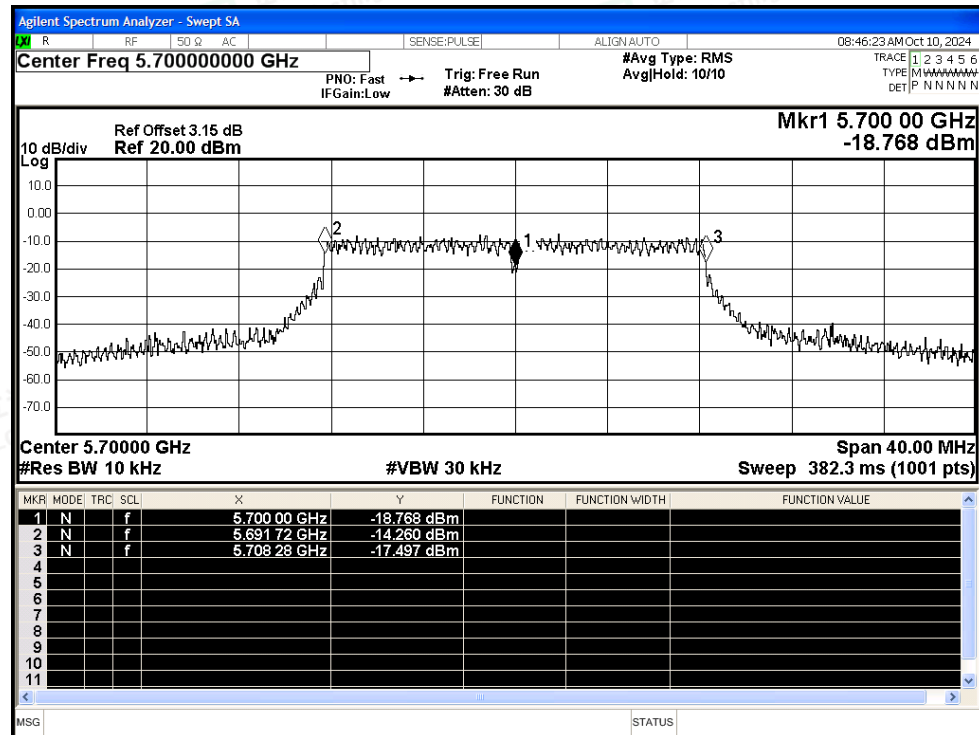


Freq. Stability NVNT n20 5500MHz Ant0

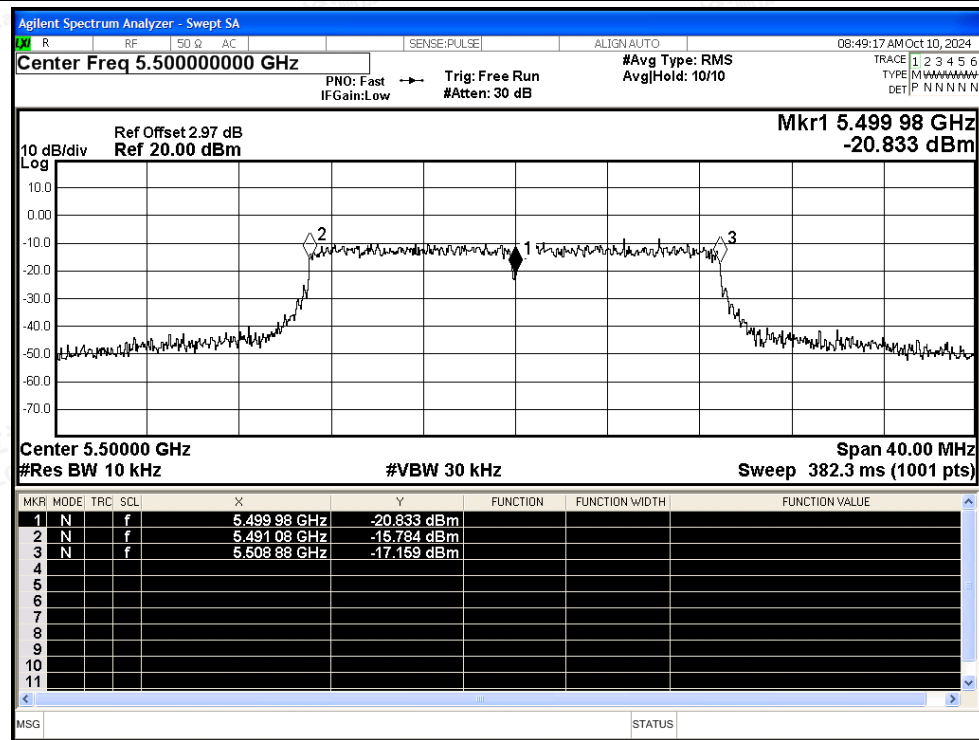




Freq. Stability NVNT n20 5580MHz Ant0

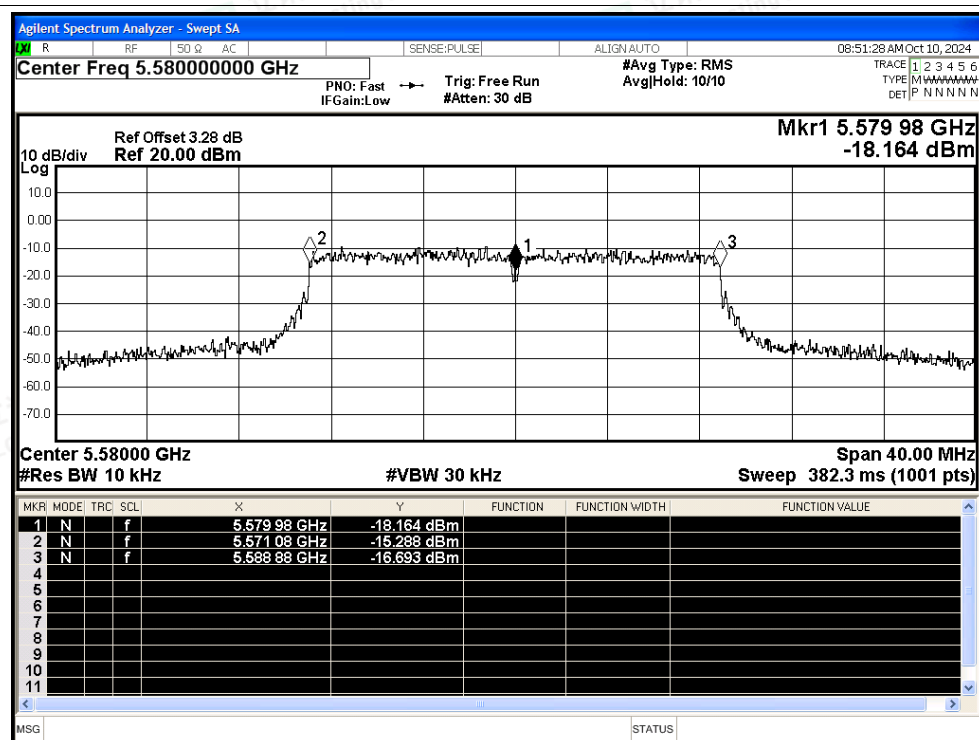


Freq. Stability NVNT n20 5700MHz Ant0

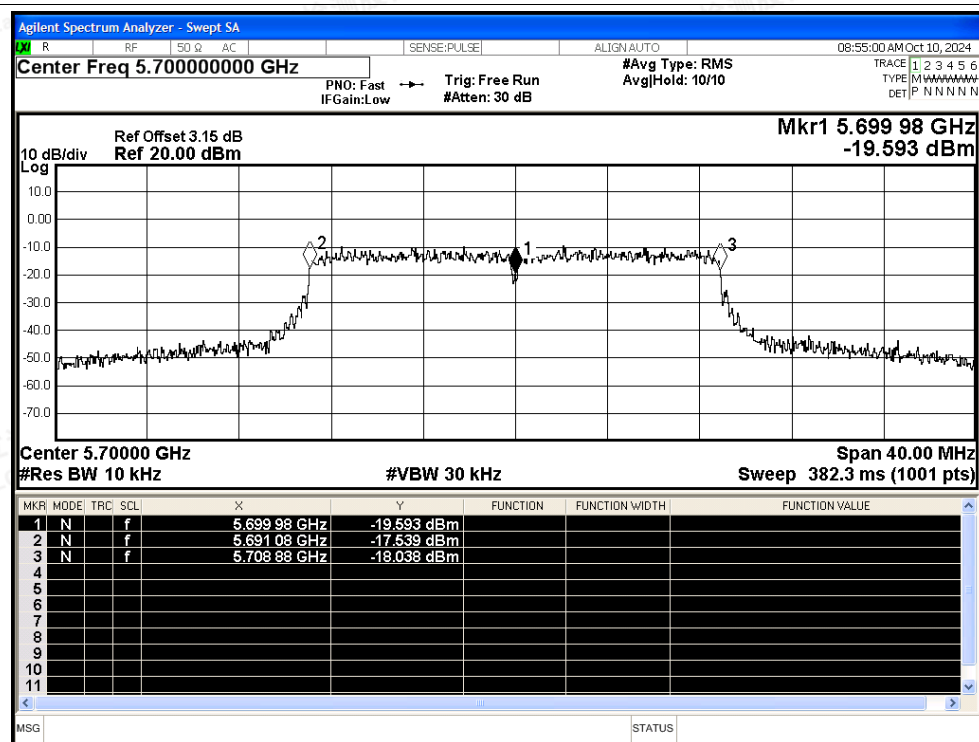




Freq. Stability NVNT n40 5510MHz Ant0

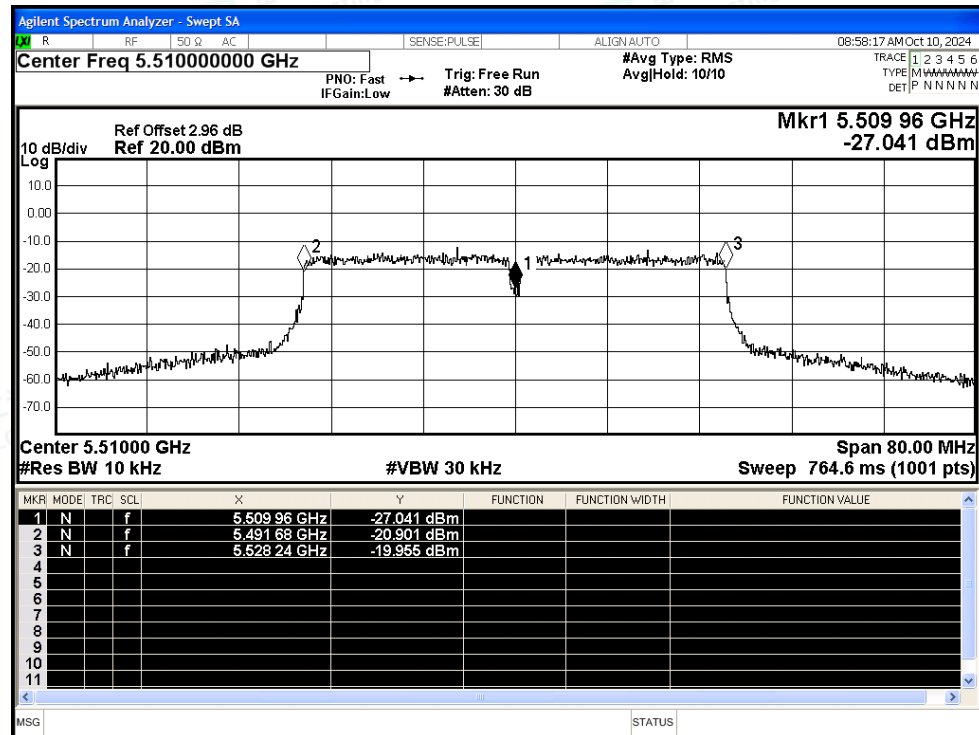


Freq. Stability NVNT n40 5550MHz Ant0

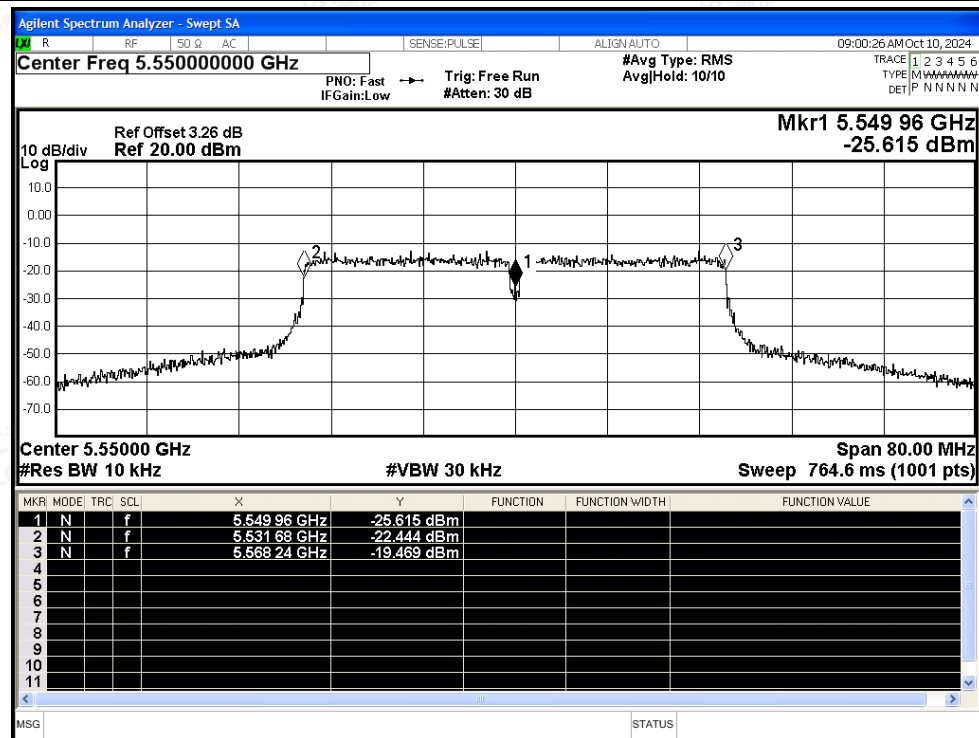




Freq. Stability NVNT n40 5670MHz Ant0

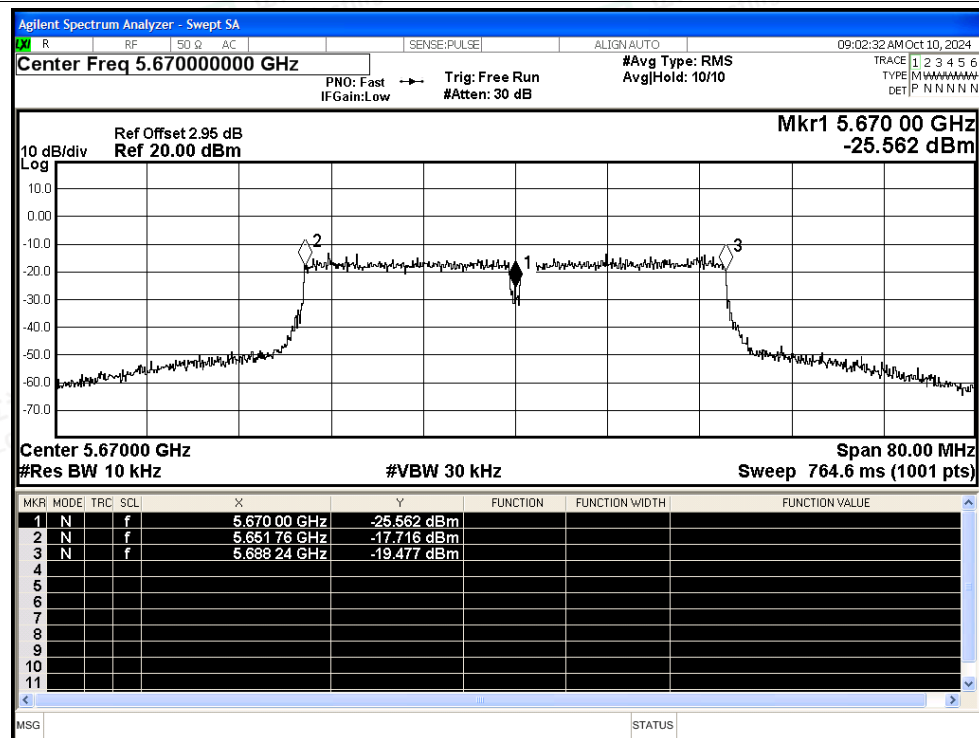


Freq. Stability NVNT ac20 5500MHz Ant0

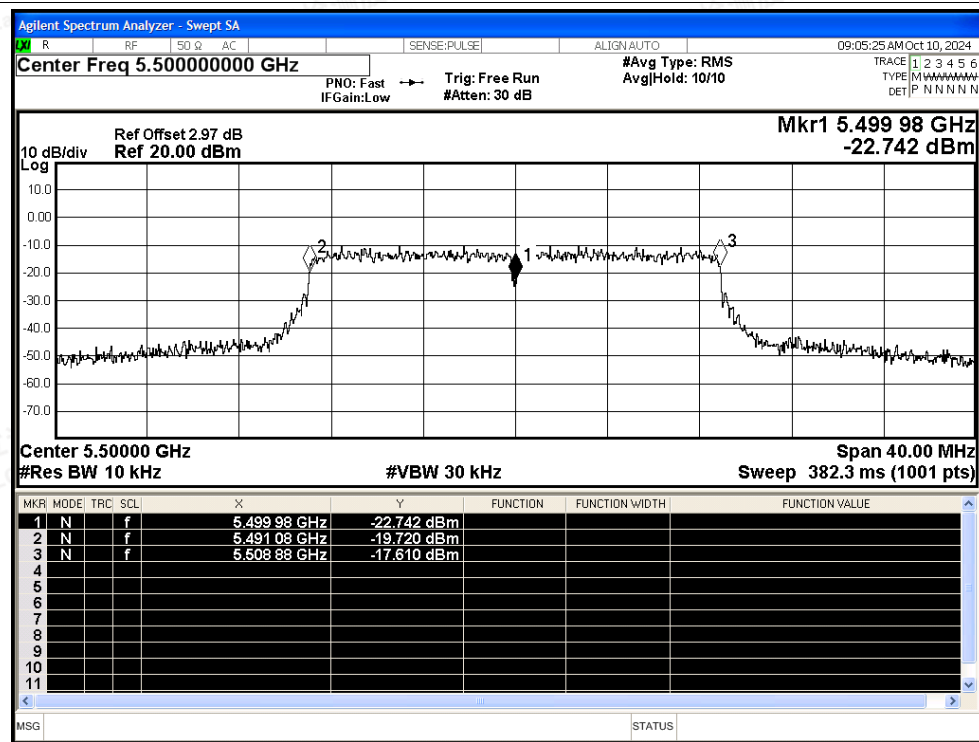




Freq. Stability NVNT ac20 5580MHz Ant0

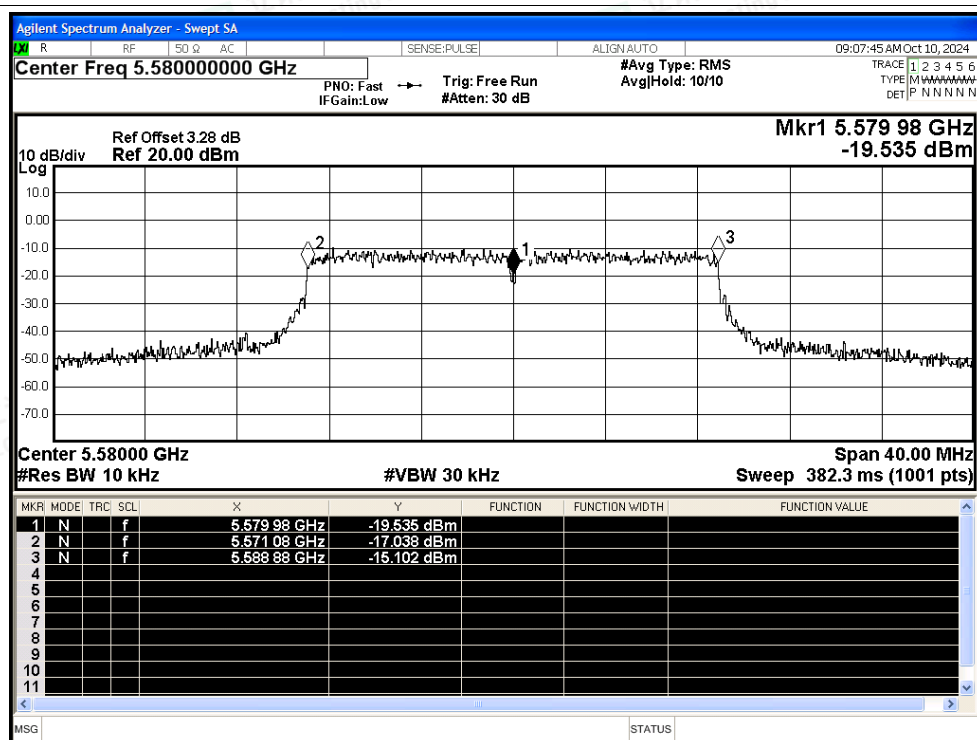


Freq. Stability NVNT ac20 5700MHz Ant0

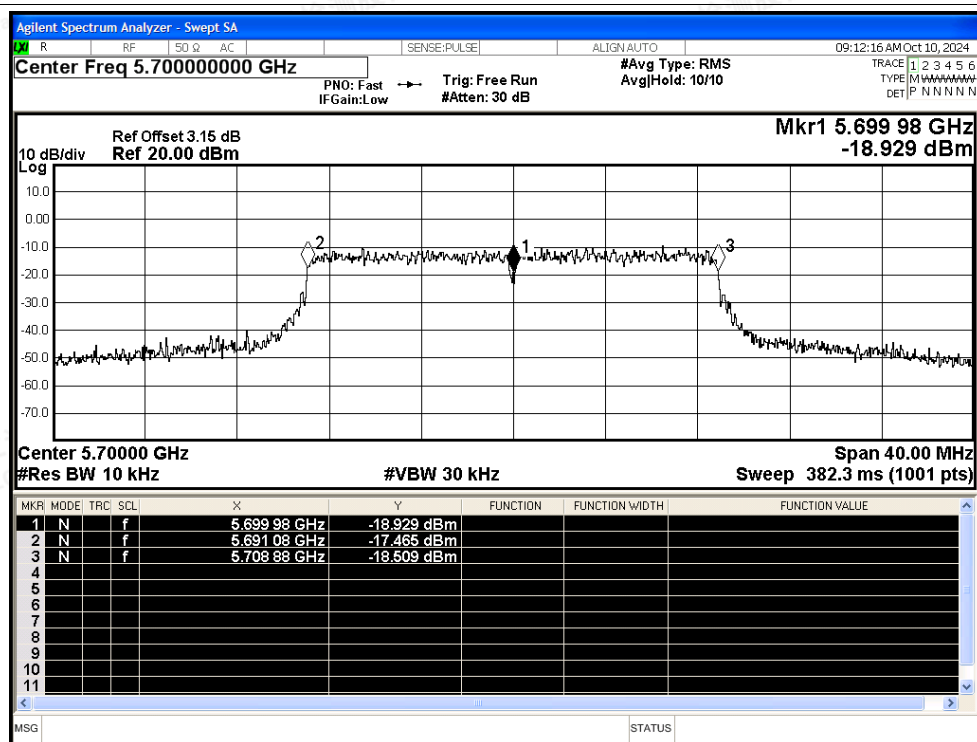




Freq. Stability NVNT ac40 5510MHz Ant0

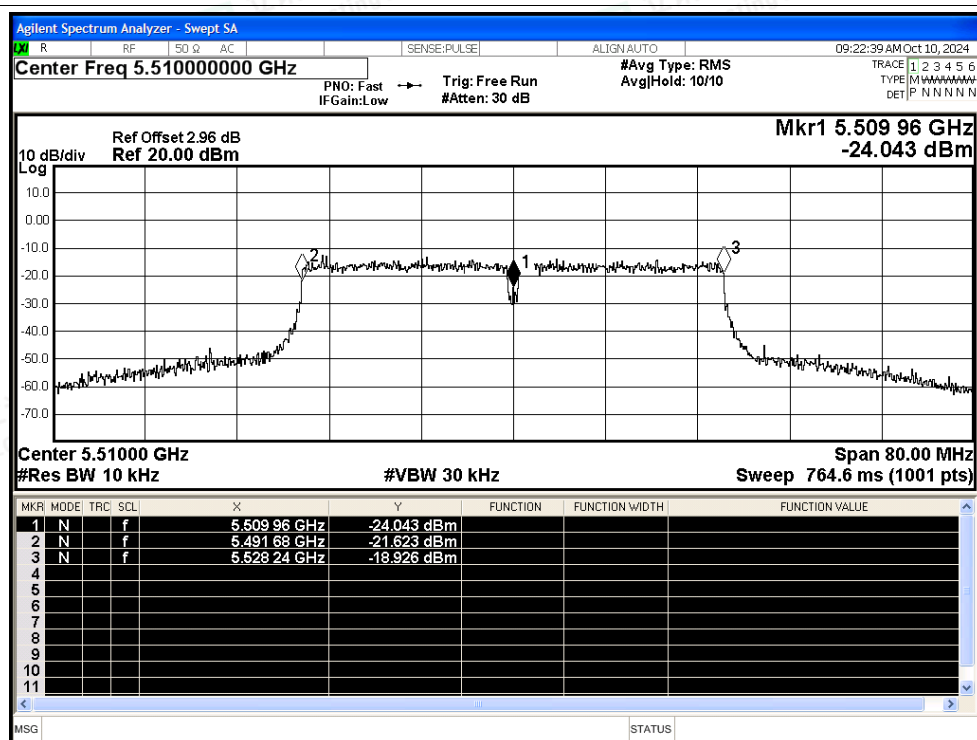


Freq. Stability NVNT ac40 5550MHz Ant0

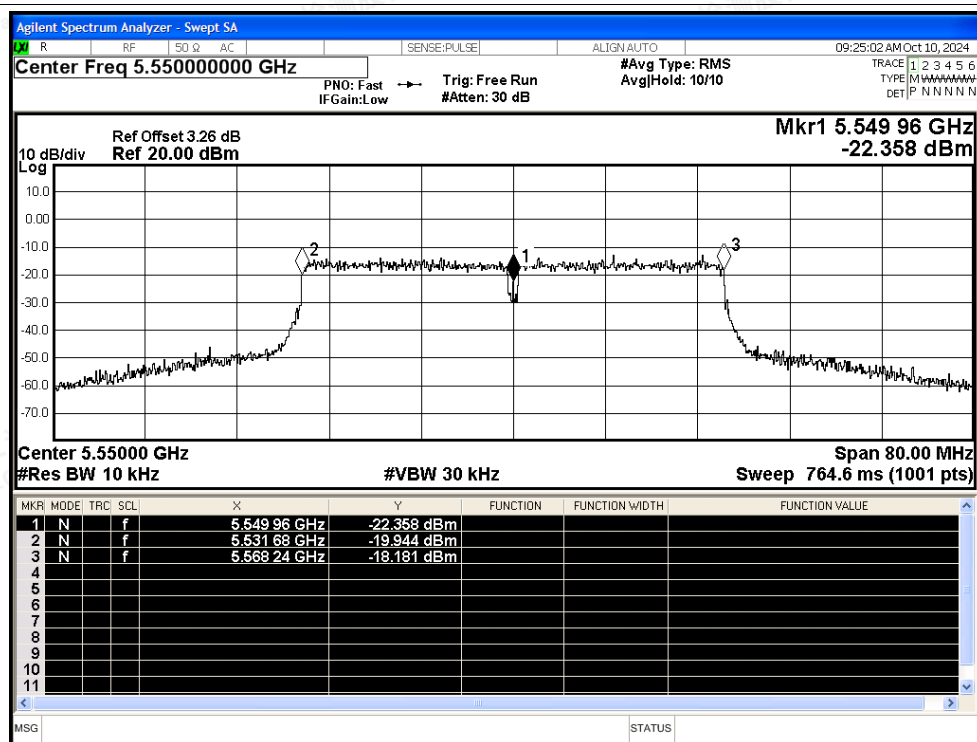




Freq. Stability NVNT ac40 5670MHz Ant0

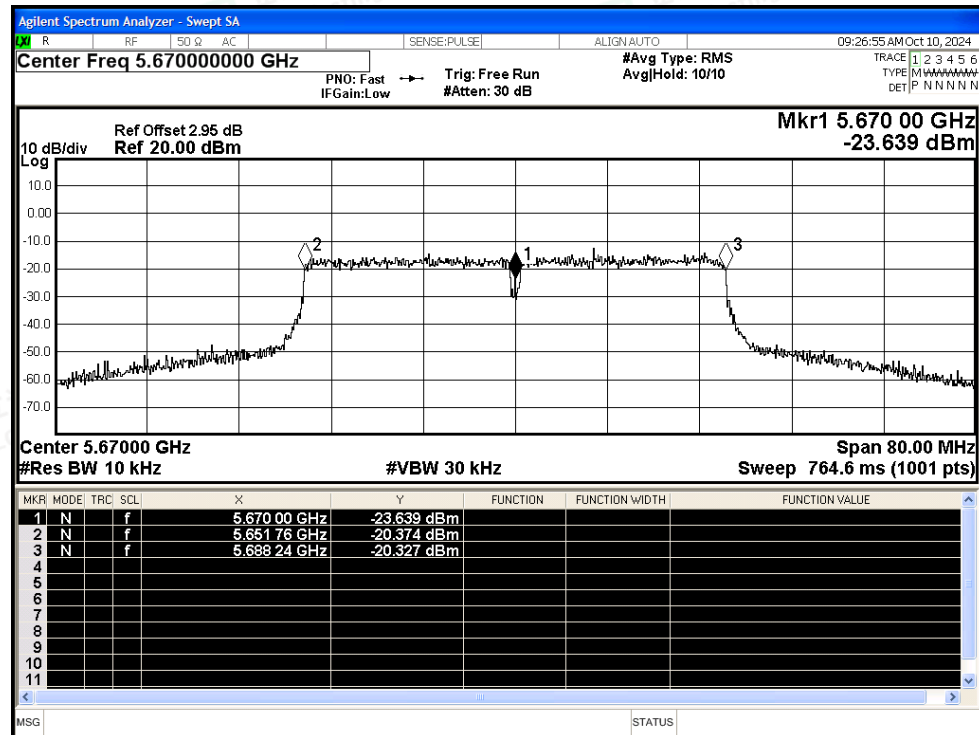


Freq. Stability NVNT ac80 5530MHz Ant0

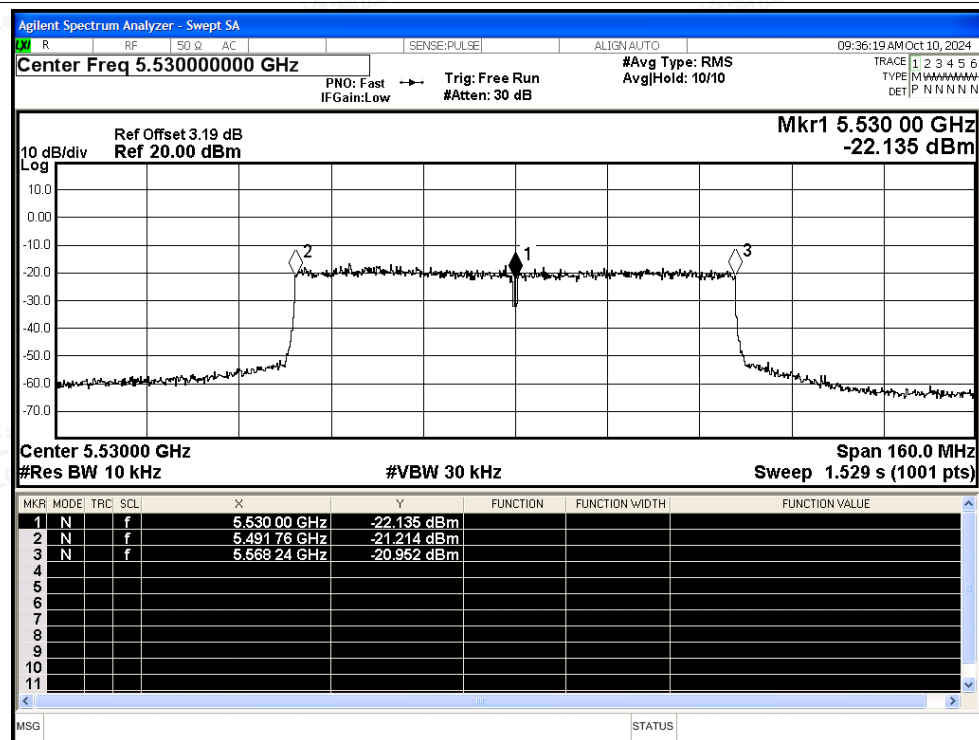




Freq. Stability NVNT ac80 5610MHz Ant0

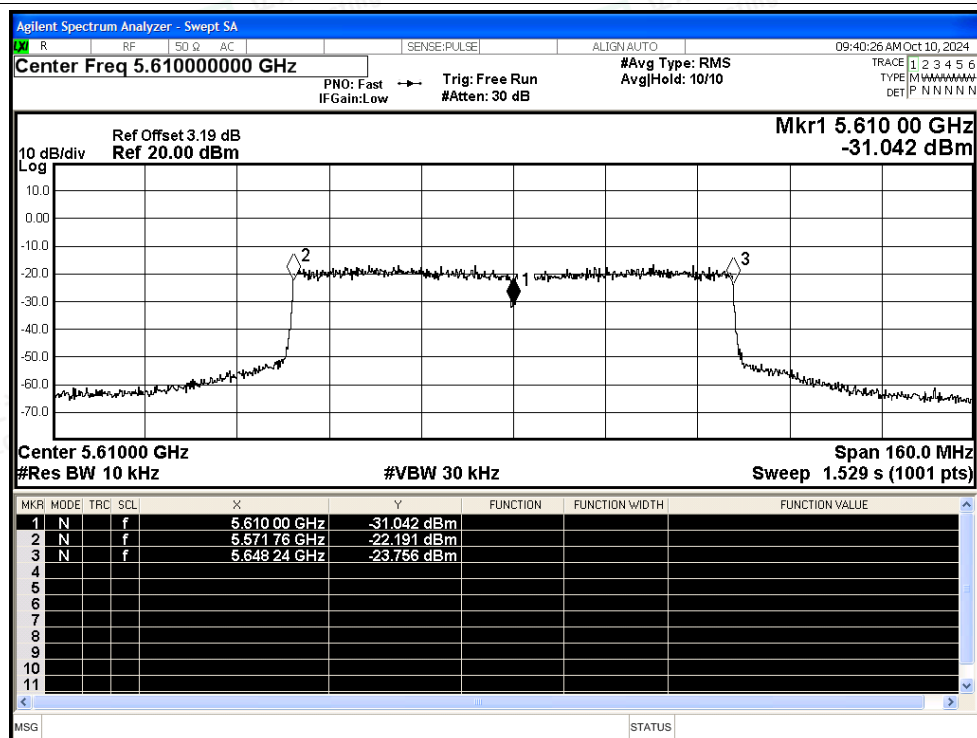


Freq. Stability NVNT ac160 5570MHz Ant0

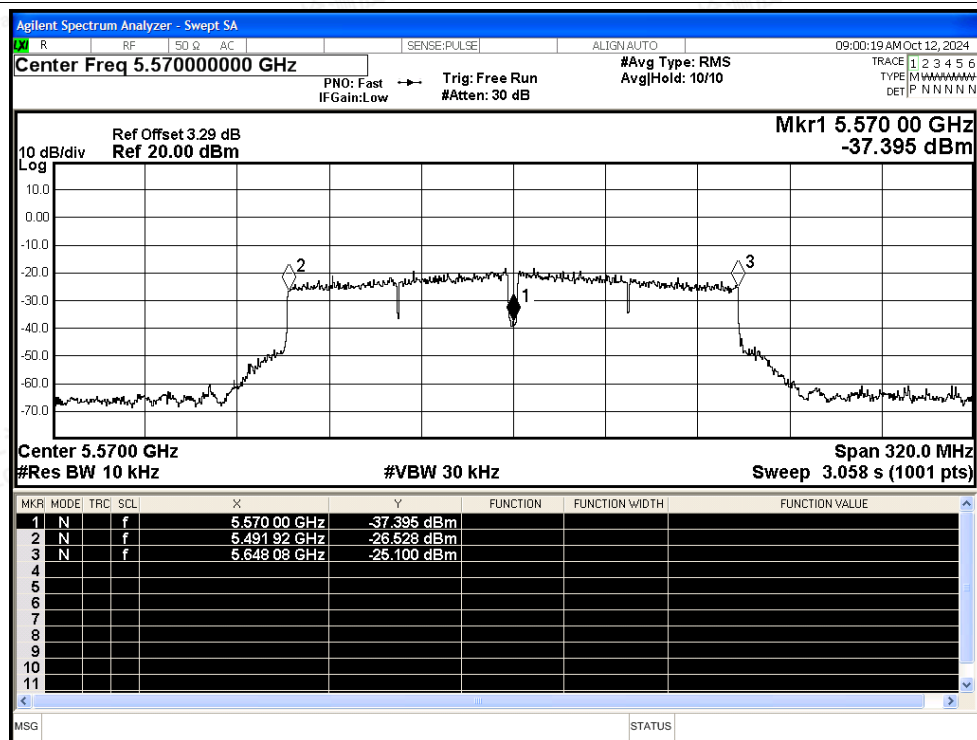




Freq. Stability NVNT ax160 5570MHz Ant0

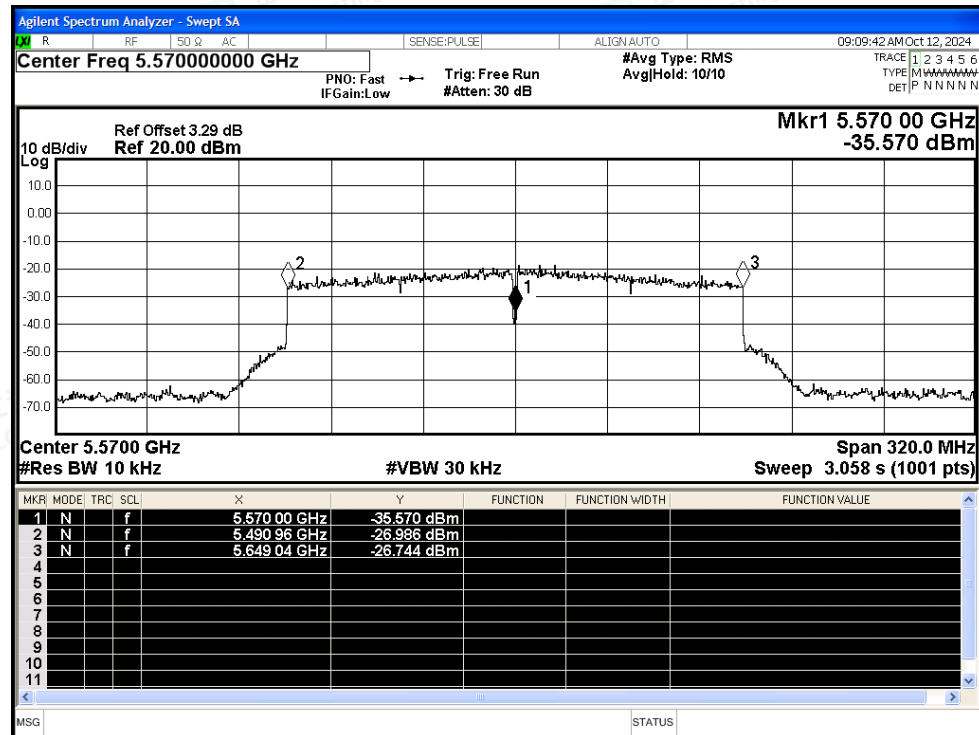


Freq. Stability NVNT ax20 5500MHz Ant0

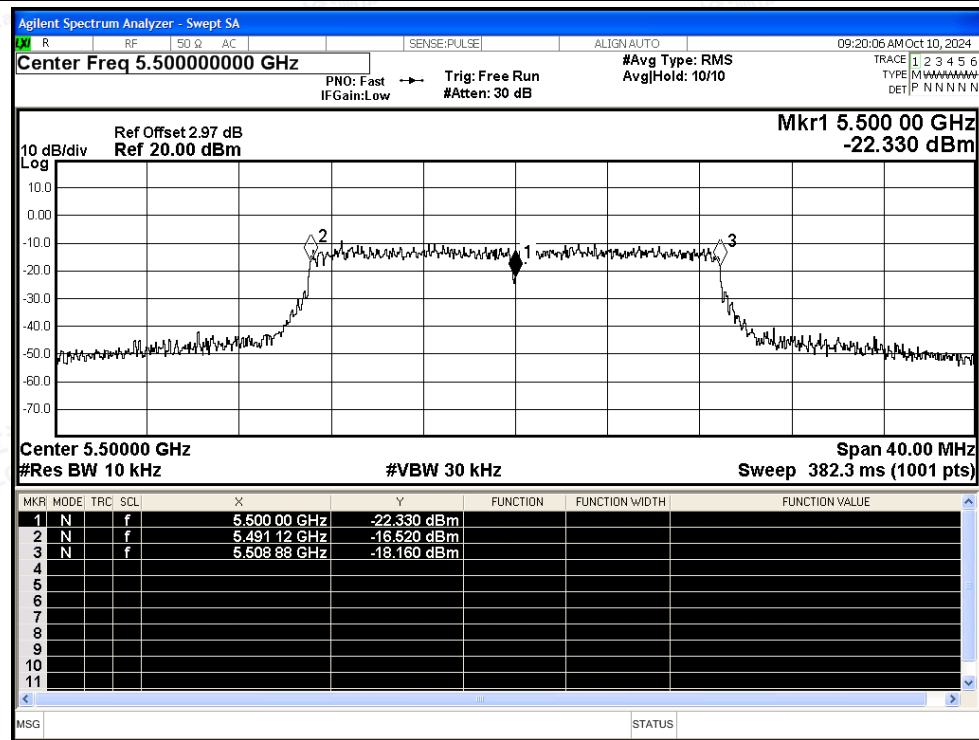




Freq. Stability NVNT ax20 5580MHz Ant0

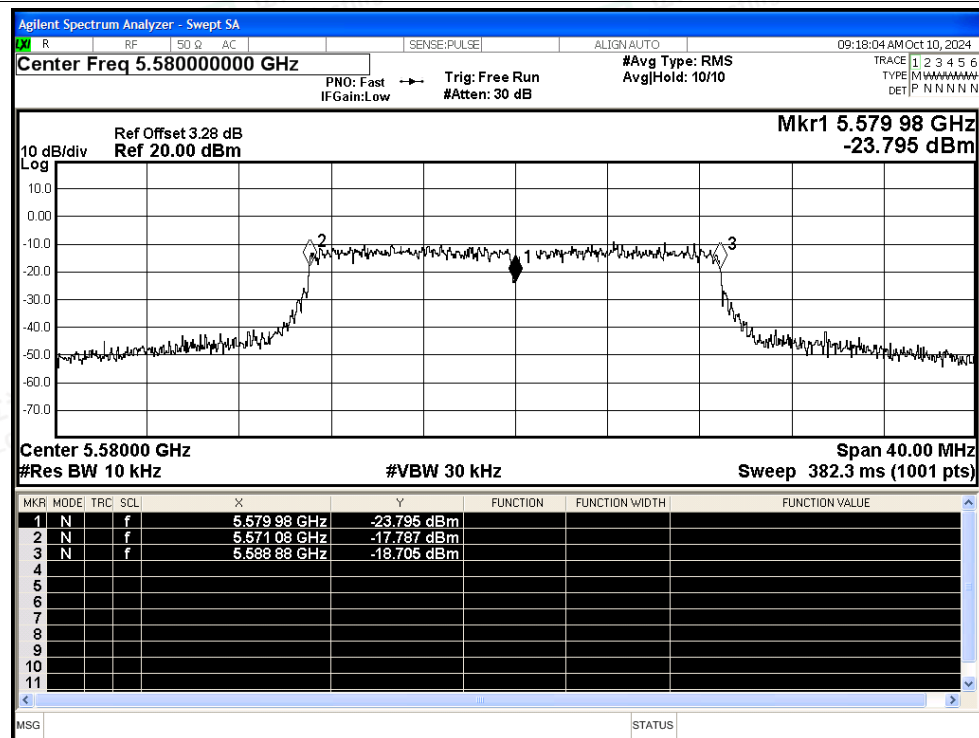


Freq. Stability NVNT ax20 5700MHz Ant0

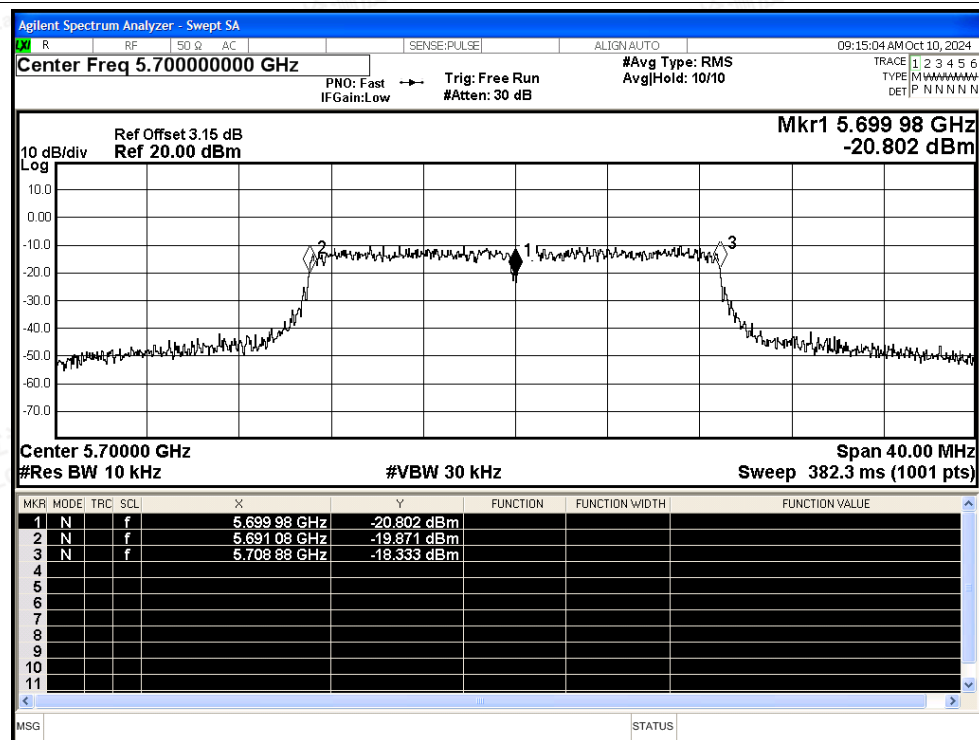




Freq. Stability NVNT ax40 5510MHz Ant0

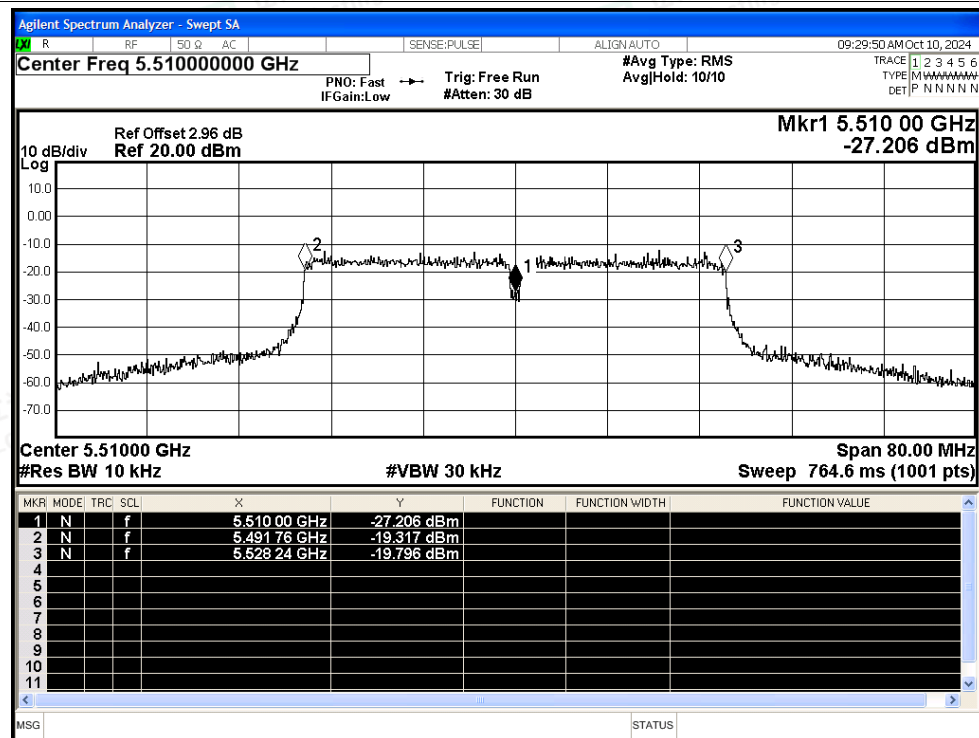


Freq. Stability NVNT ax40 5550MHz Ant0

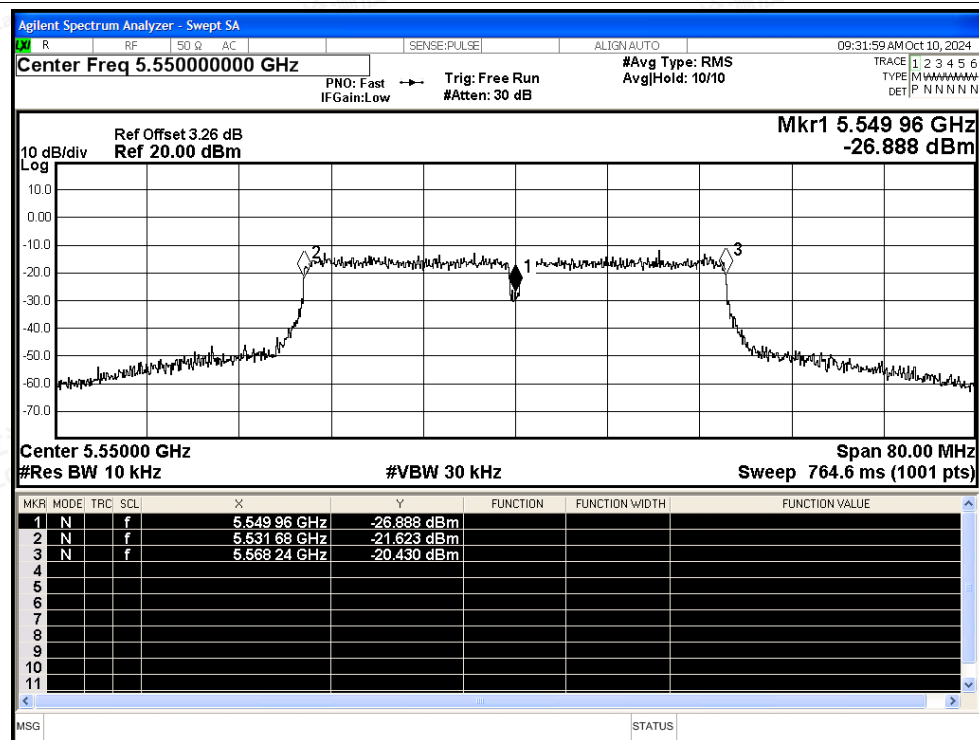





Freq. Stability NVNT ax40 5670MHz Ant0

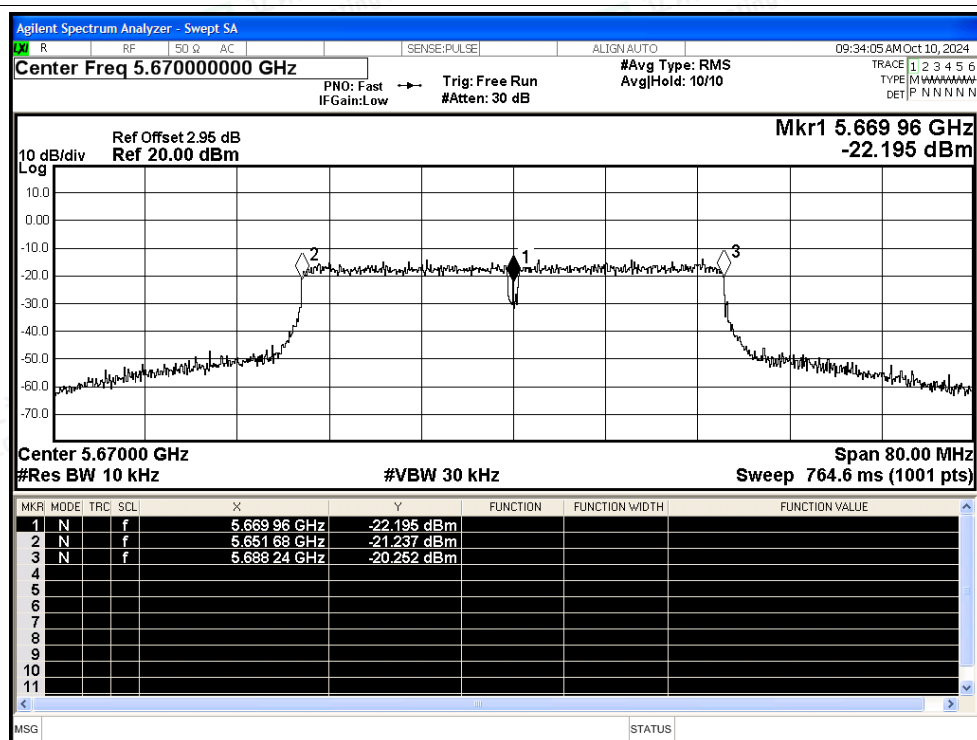

Freq. Stability NVNT ax80 5530MHz Ant0

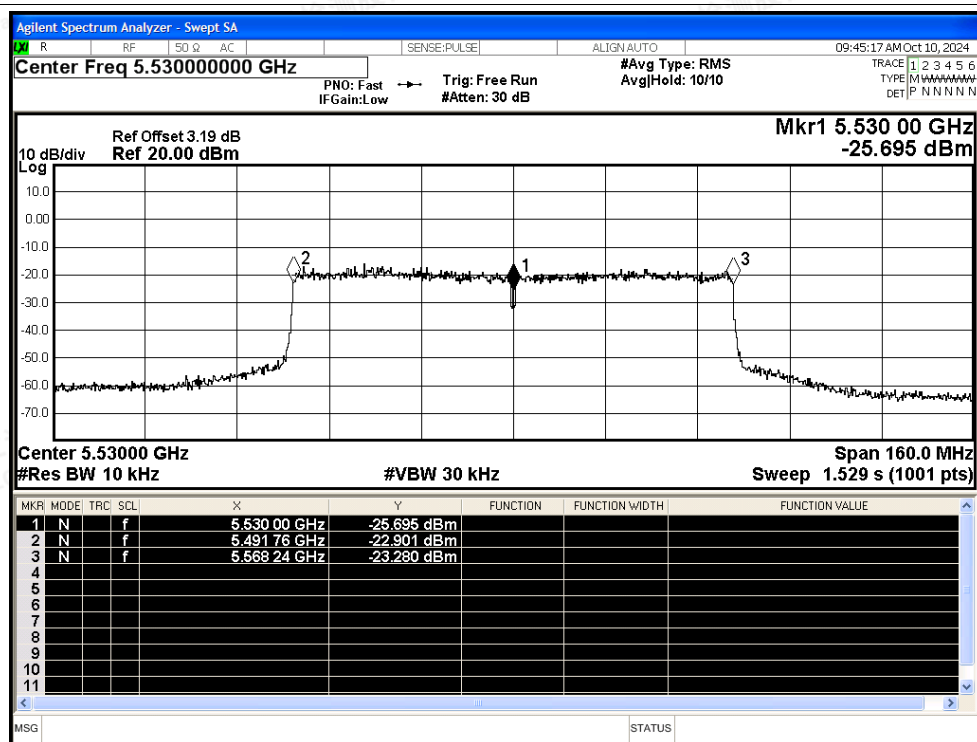

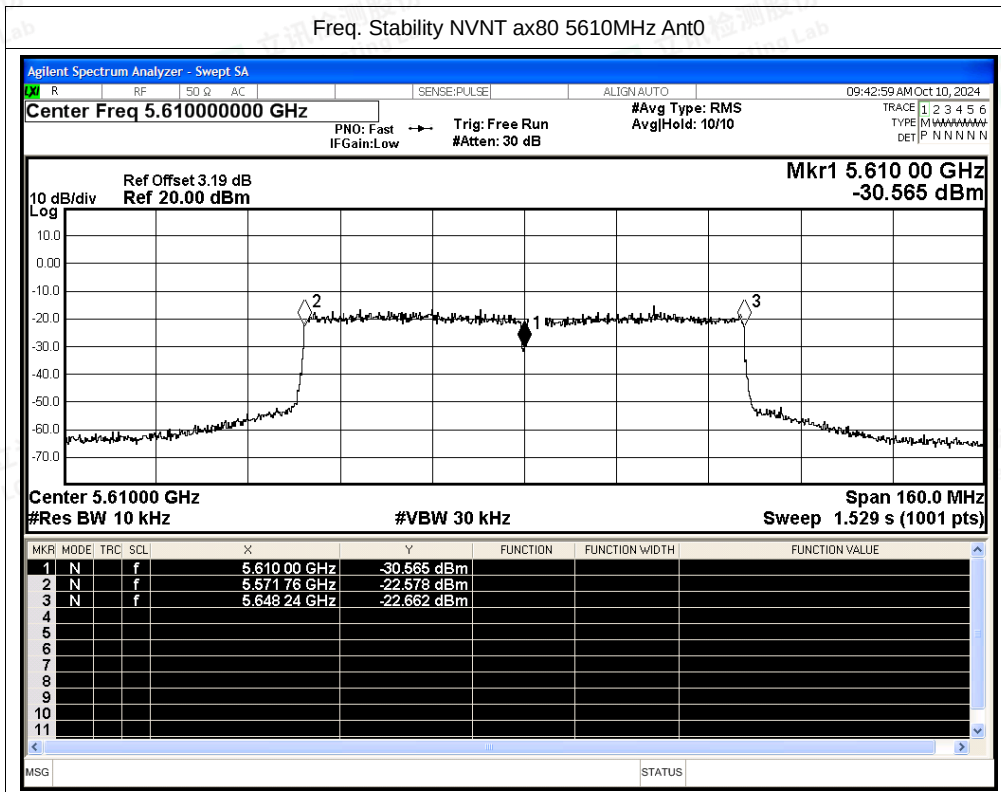



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant1	5500	0	0	25	Pass
NVNT	a	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant1	5700	0	0	25	Pass
NVNT	n40	5510	Ant1	5510	0	0	25	Pass
NVNT	n40	5550	Ant1	5550	0	0	25	Pass
NVNT	n40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant1	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant1	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant1	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant1	5550	0	0	25	Pass
NVNT	ac40	5670	Ant1	5670	0	0	25	Pass
NVNT	ac80	5530	Ant1	5530	0	0	25	Pass
NVNT	ac80	5610	Ant1	5610	0	0	25	Pass
NVNT	ac160	5570	Ant1	5570	0	0	25	Pass
NVNT	ax160	5570	Ant1	5570	0	0	25	Pass
NVNT	ax20	5500	Ant1	5499.98	-20000	-3.64	25	Pass
NVNT	ax20	5580	Ant1	5580	0	0	25	Pass
NVNT	ax20	5700	Ant1	5700	0	0	25	Pass
NVNT	ax40	5510	Ant1	5510	0	0	25	Pass
NVNT	ax40	5550	Ant1	5550	0	0	25	Pass
NVNT	ax40	5670	Ant1	5669.96	-40000	-7.05	25	Pass
NVNT	ax80	5530	Ant1	5530	0	0	25	Pass
NVNT	ax80	5610	Ant1	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant1

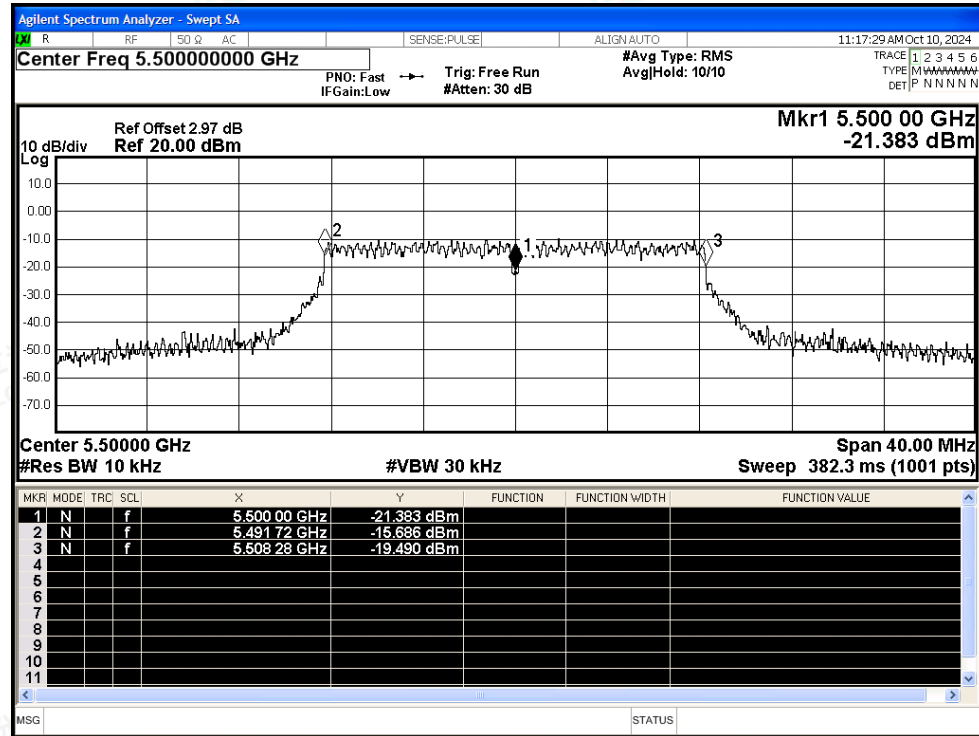


Freq. Stability NVNT a 5580MHz Ant1

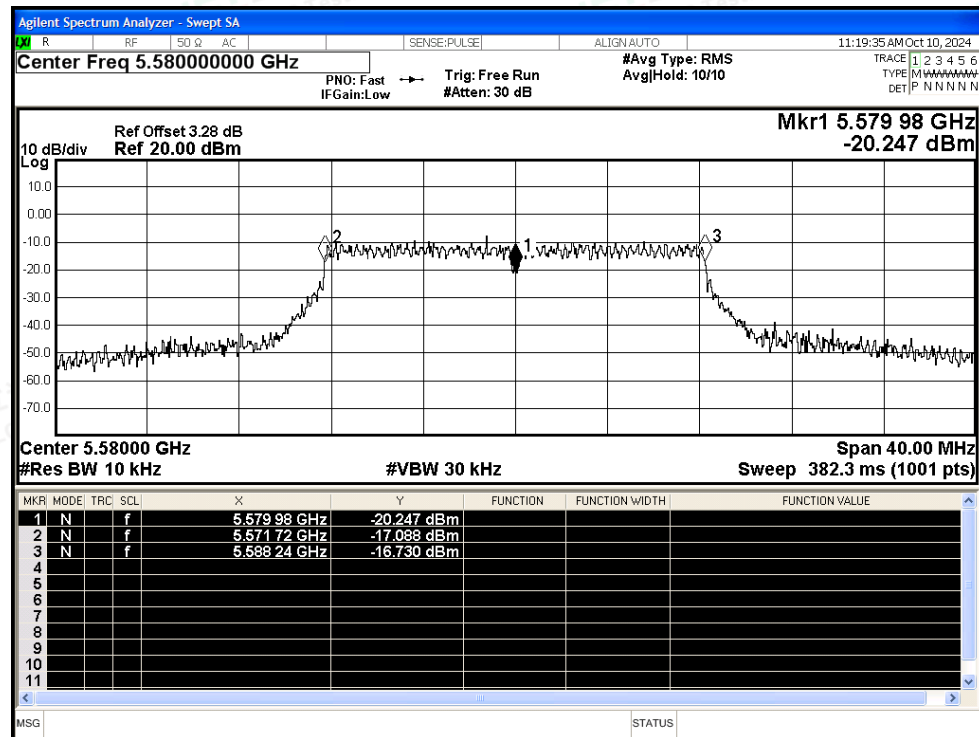


Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant1

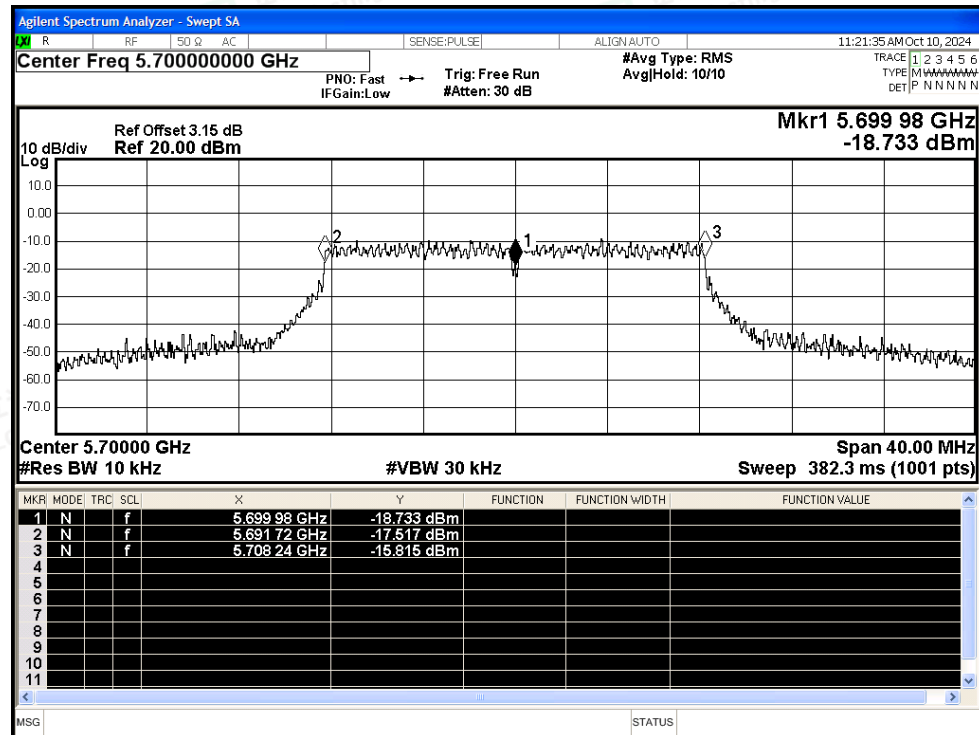


Freq. Stability NVNT n20 5500MHz Ant1

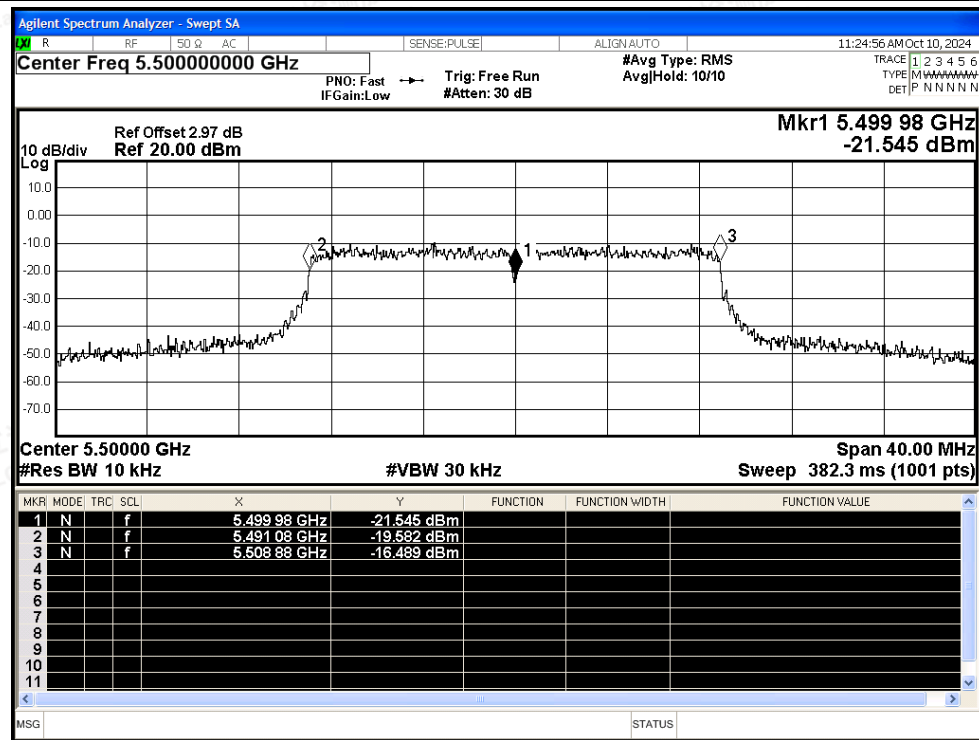




Freq. Stability NVNT n20 5580MHz Ant1

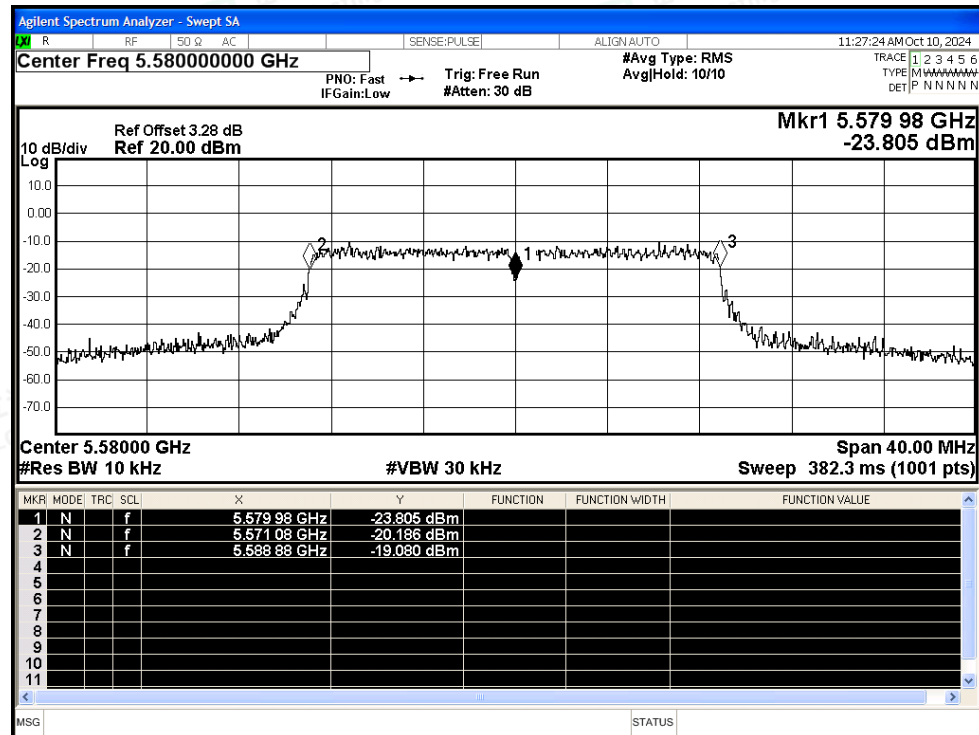


Freq. Stability NVNT n20 5700MHz Ant1

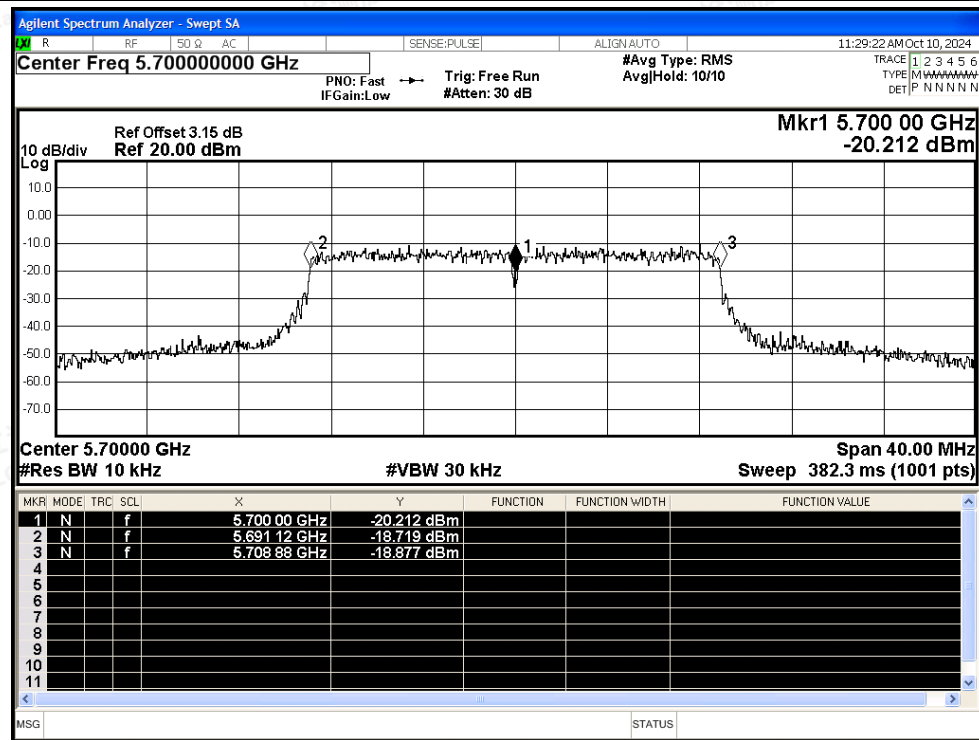




Freq. Stability NVNT n40 5510MHz Ant1

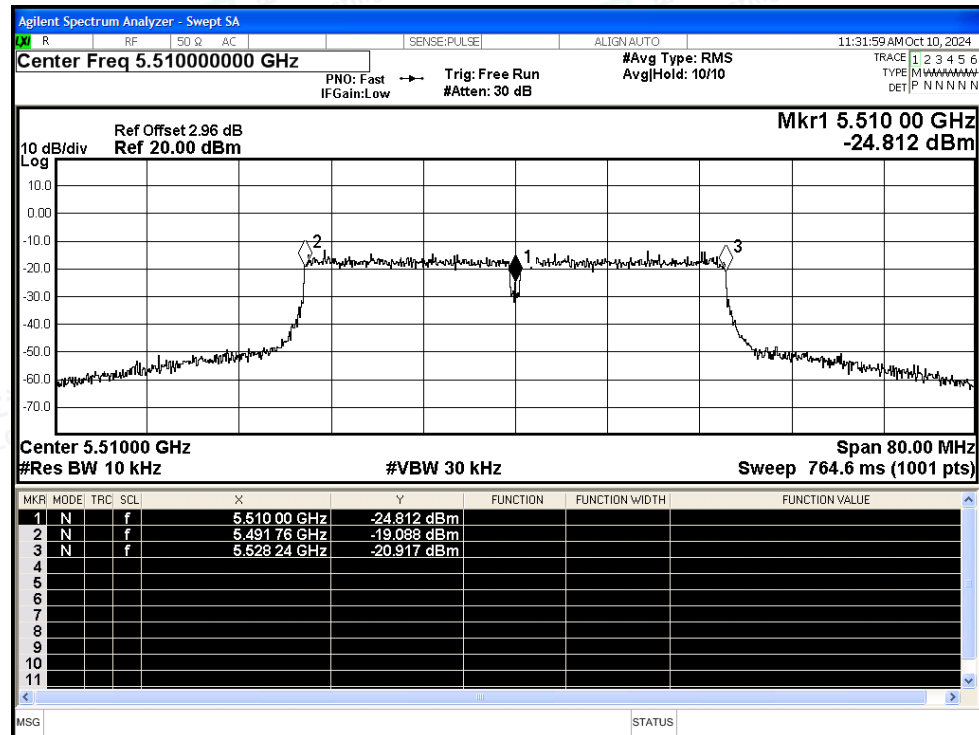


Freq. Stability NVNT n40 5550MHz Ant1

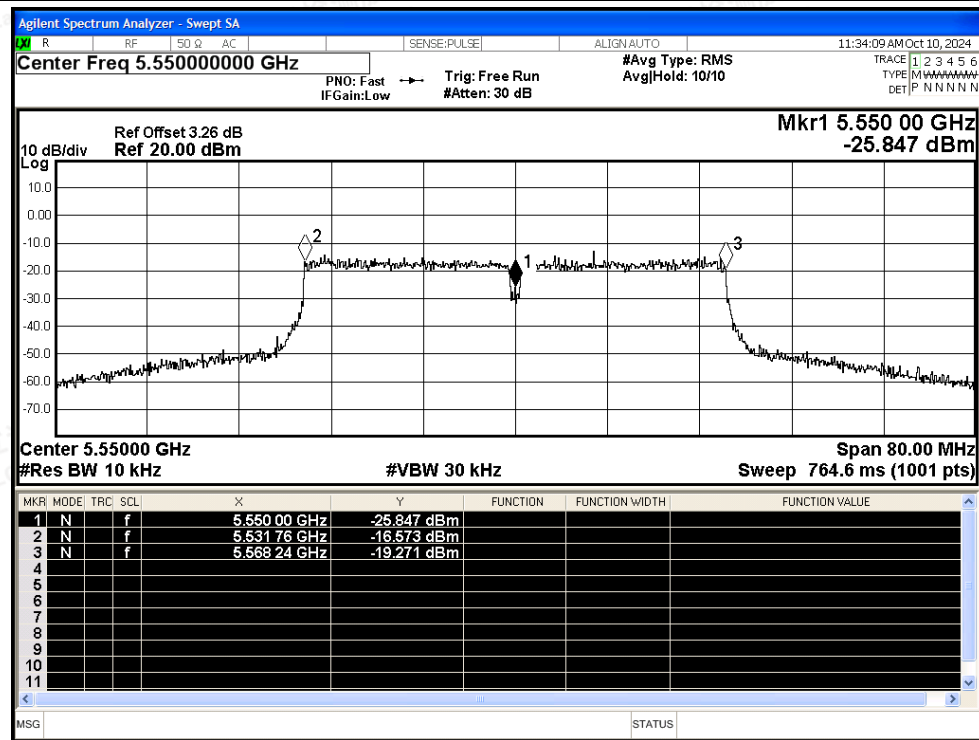




Freq. Stability NVNT n40 5670MHz Ant1

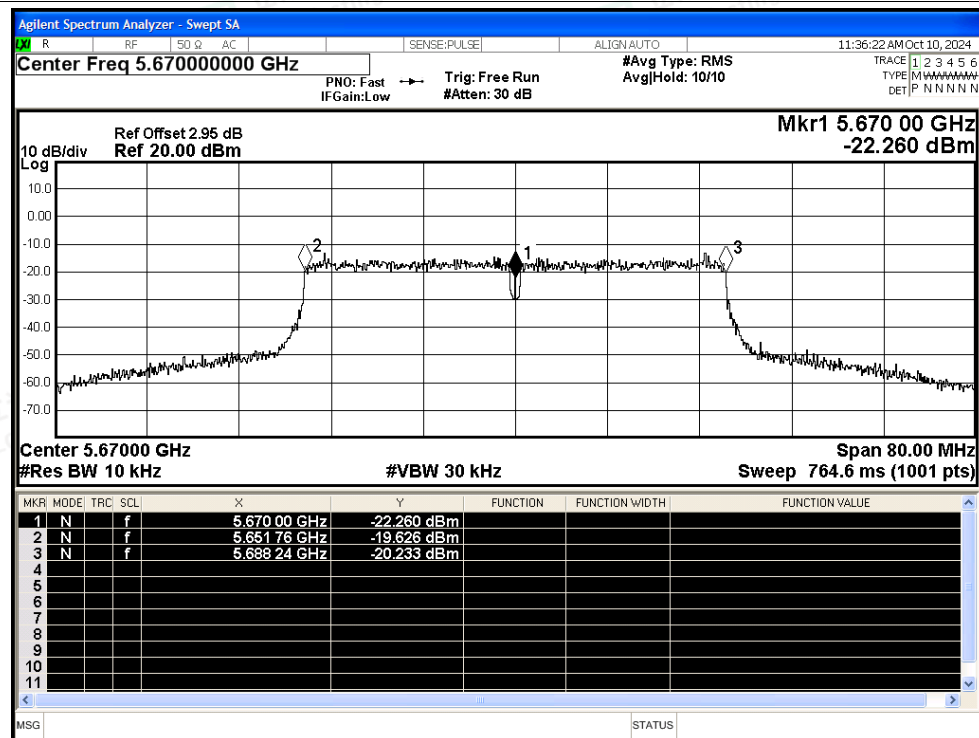


Freq. Stability NVNT ac20 5500MHz Ant1

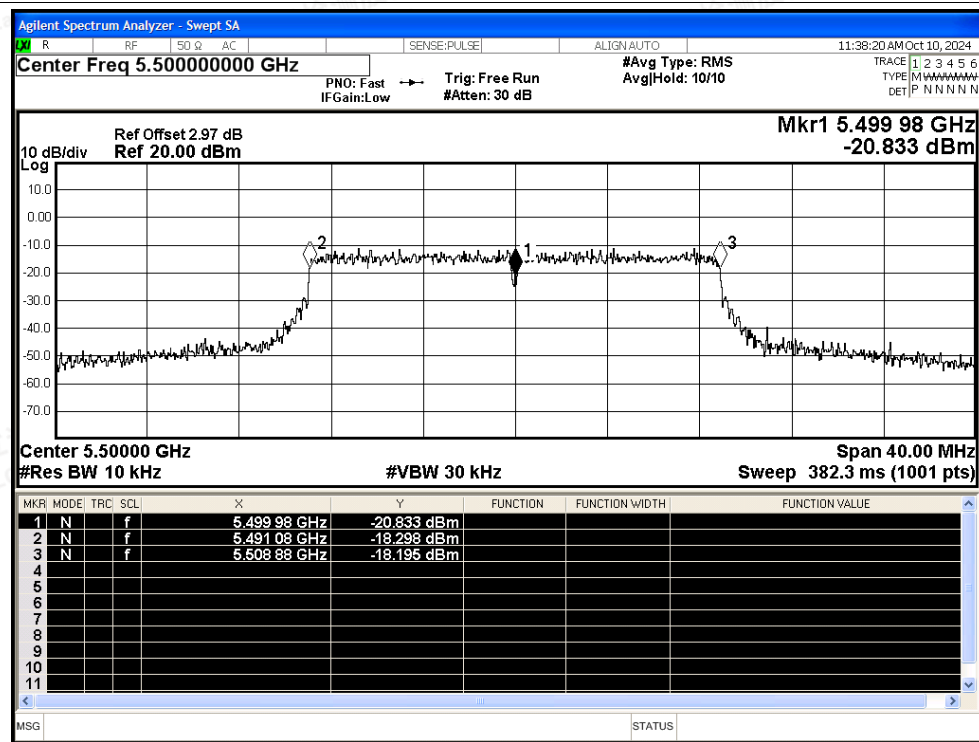




Freq. Stability NVNT ac20 5580MHz Ant1

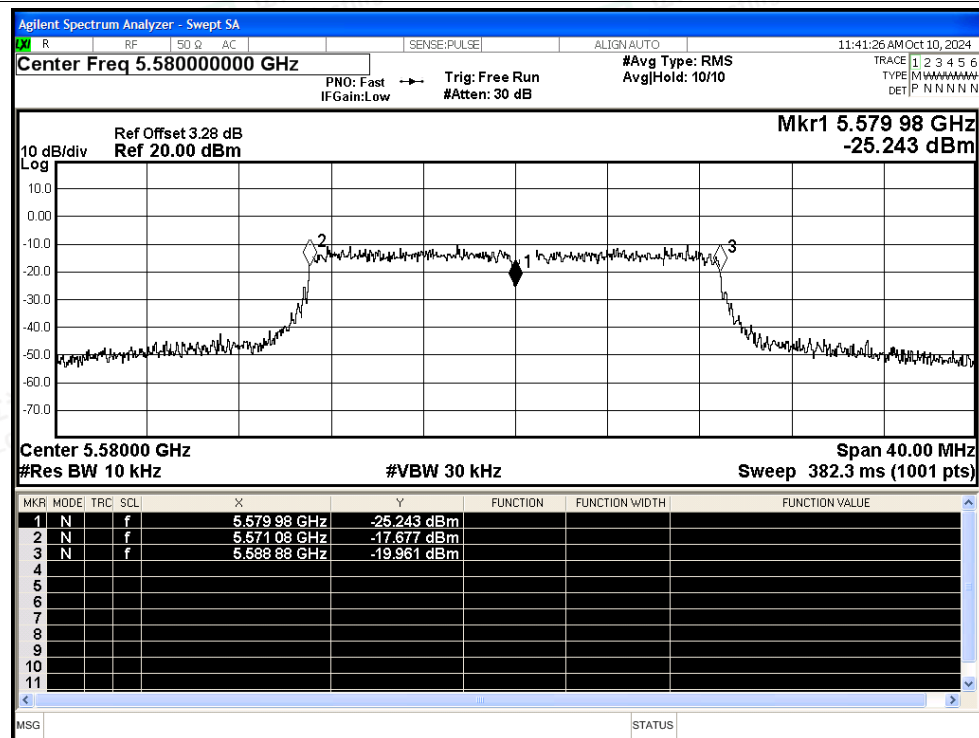


Freq. Stability NVNT ac20 5700MHz Ant1

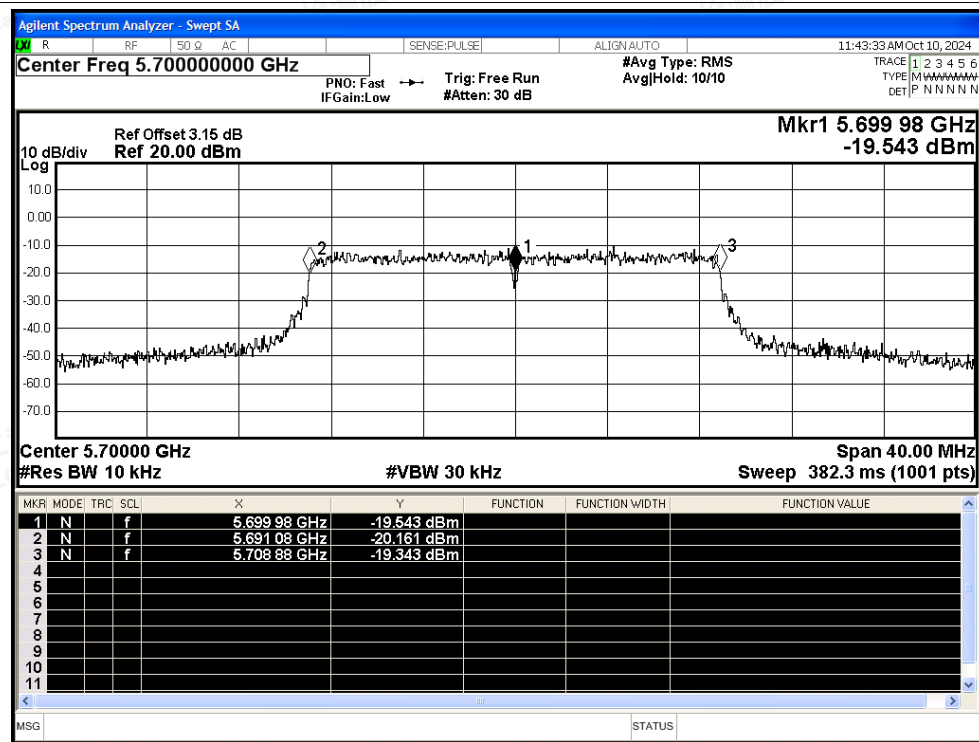




Freq. Stability NVNT ac40 5510MHz Ant1

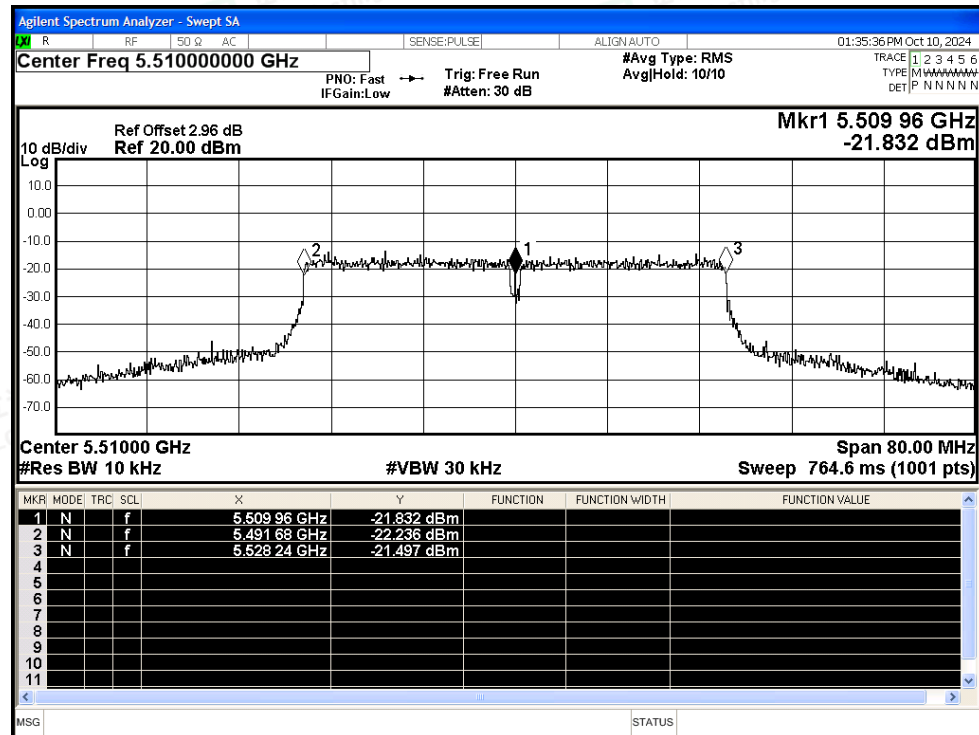


Freq. Stability NVNT ac40 5550MHz Ant1

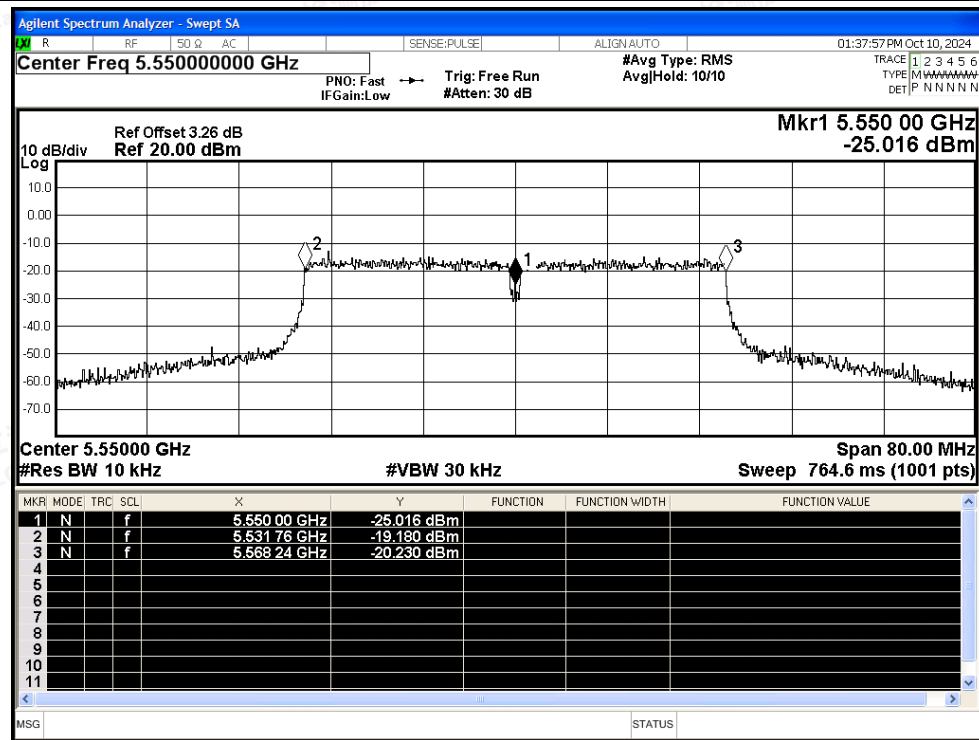




Freq. Stability NVNT ac40 5670MHz Ant1

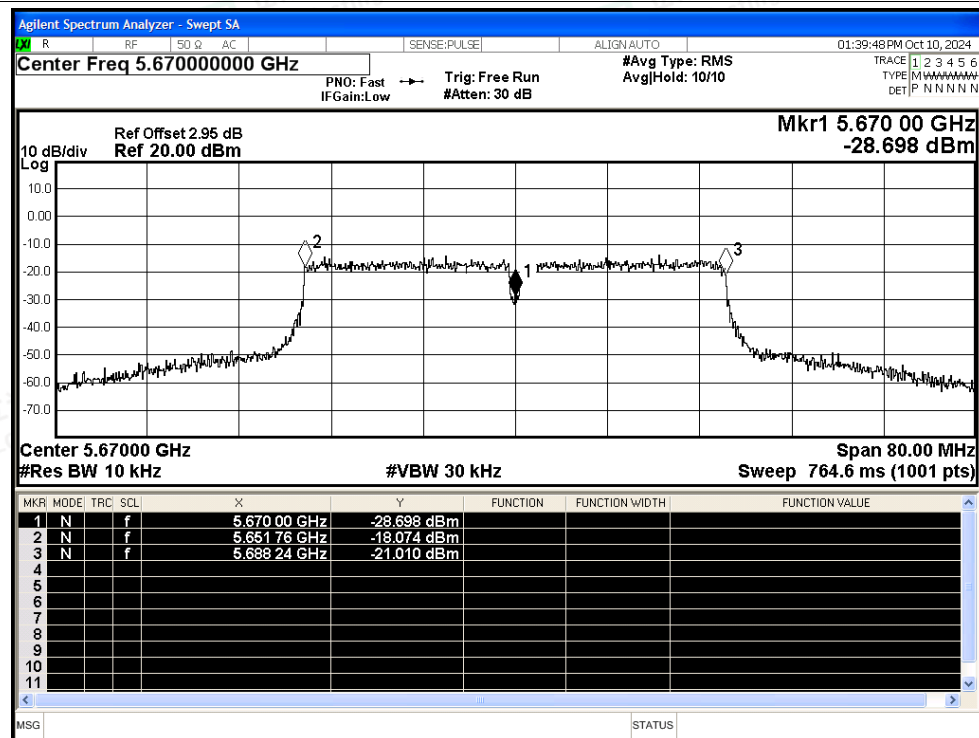


Freq. Stability NVNT ac80 5530MHz Ant1

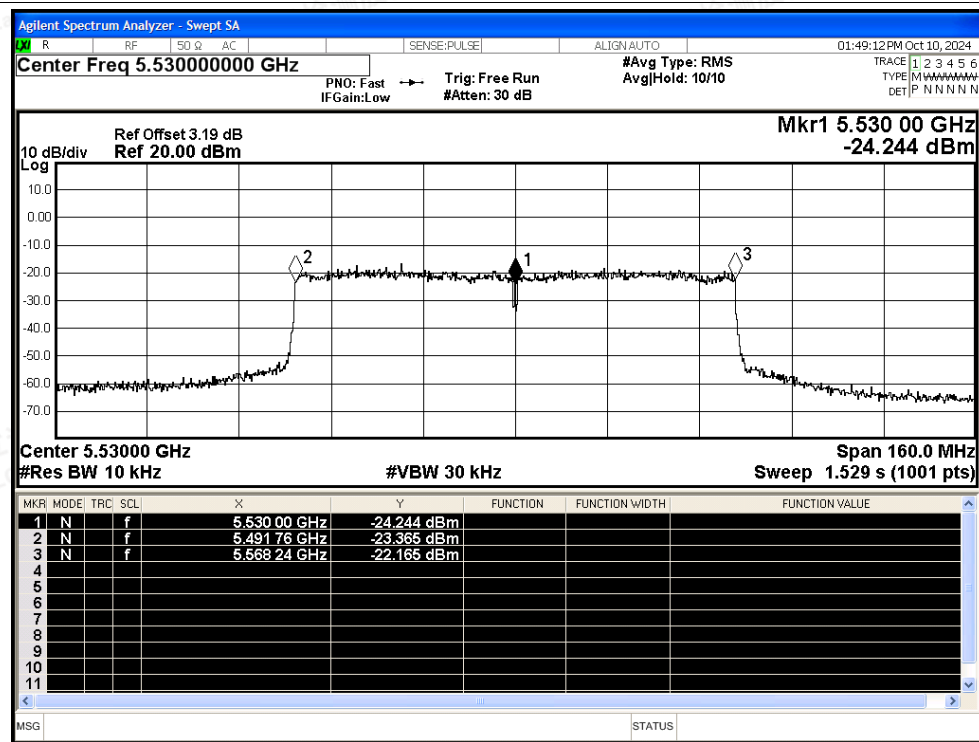




Freq. Stability NVNT ac80 5610MHz Ant1

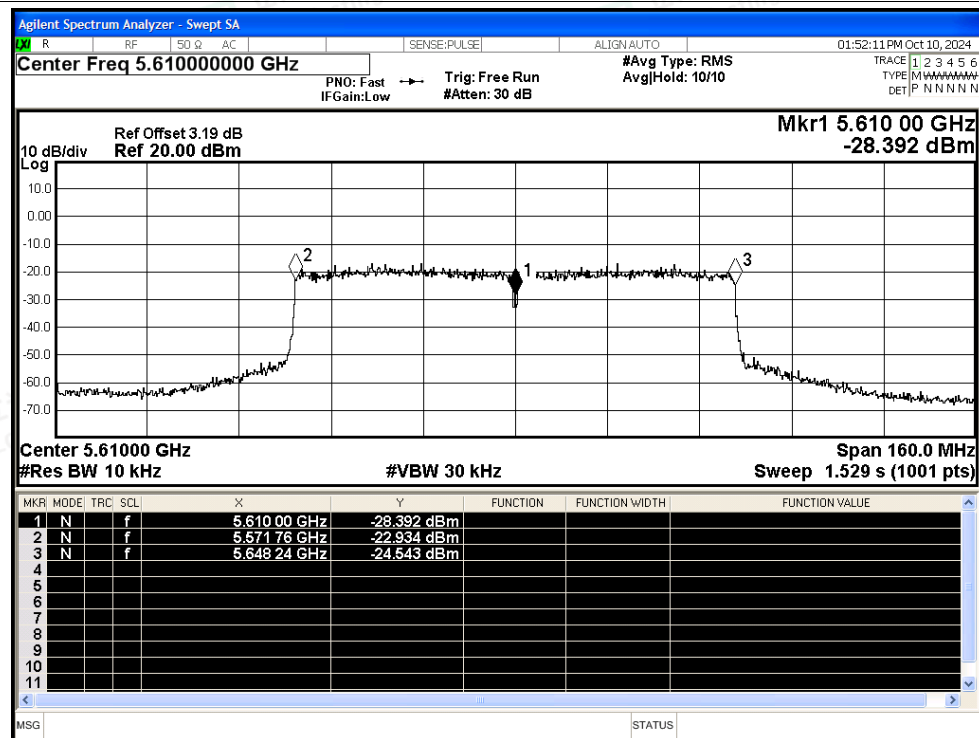


Freq. Stability NVNT ac160 5570MHz Ant1

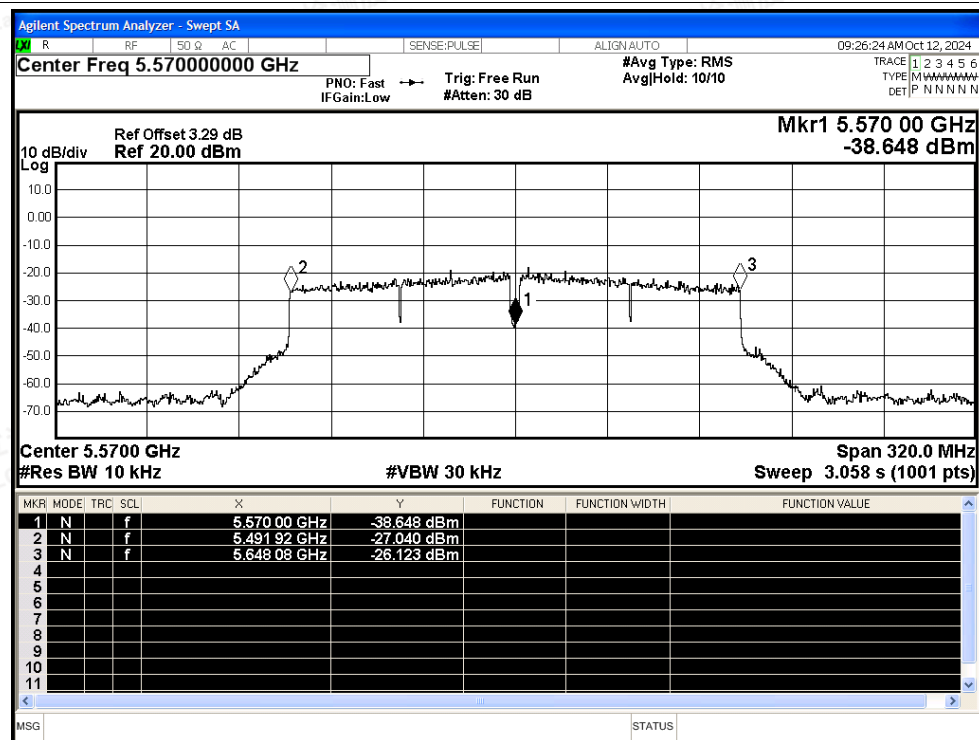




Freq. Stability NVNT ax160 5570MHz Ant1

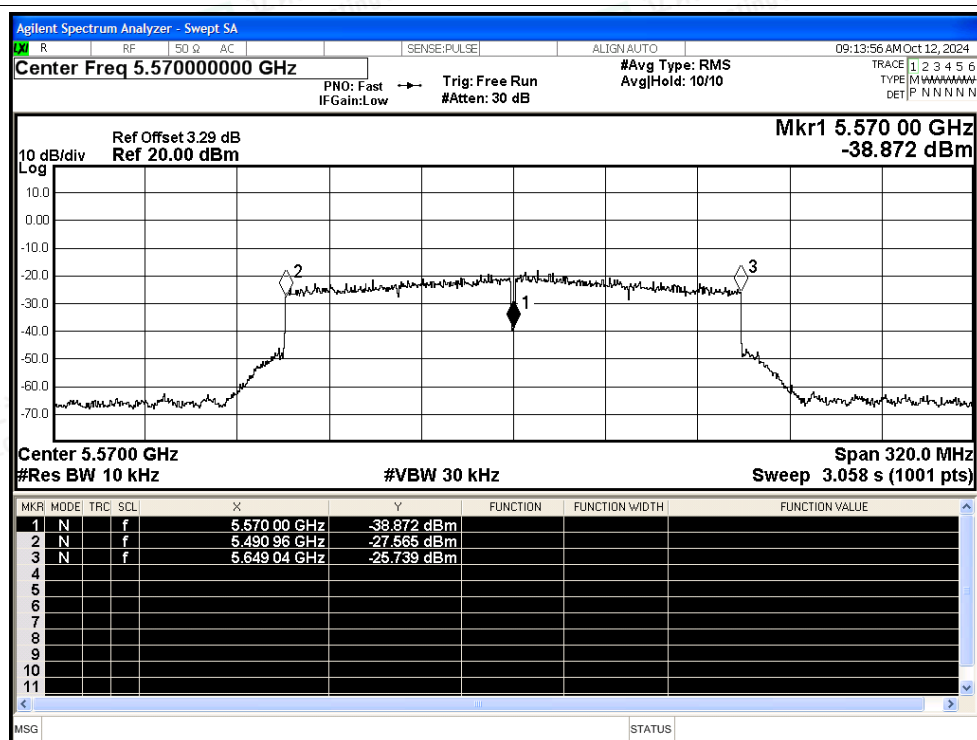


Freq. Stability NVNT ax20 5500MHz Ant1

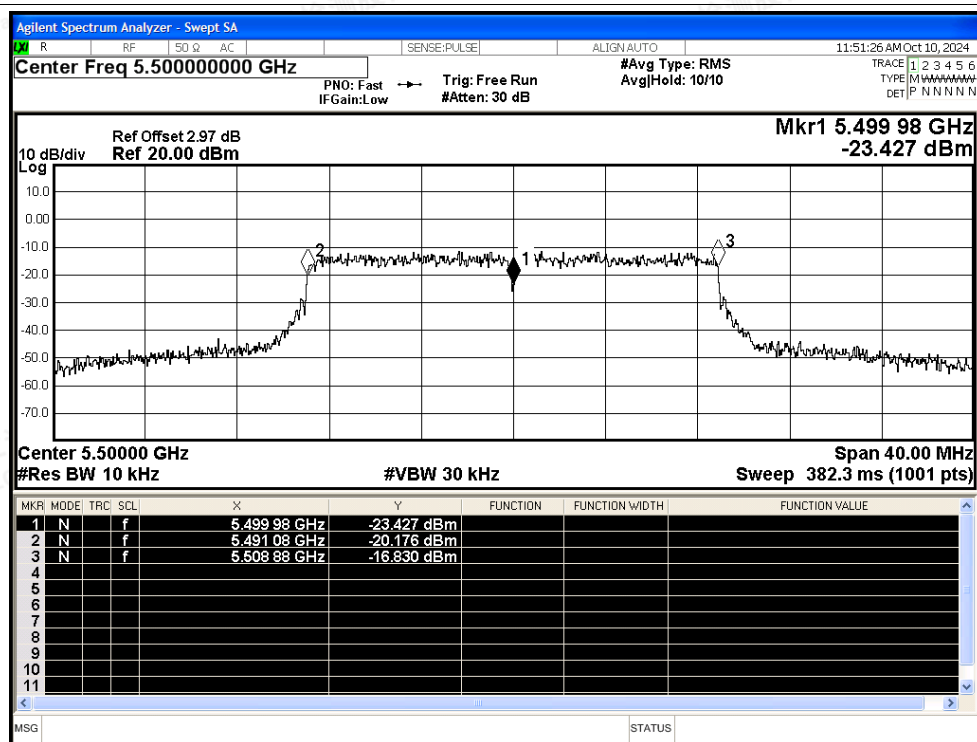




Freq. Stability NVNT ax20 5580MHz Ant1

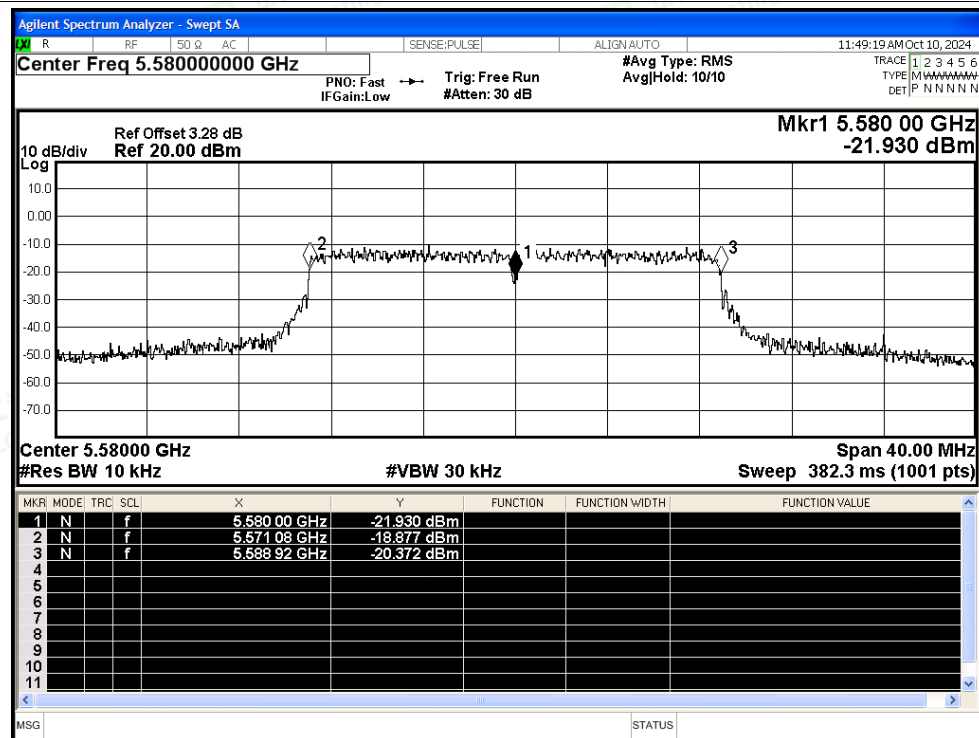


Freq. Stability NVNT ax20 5700MHz Ant1

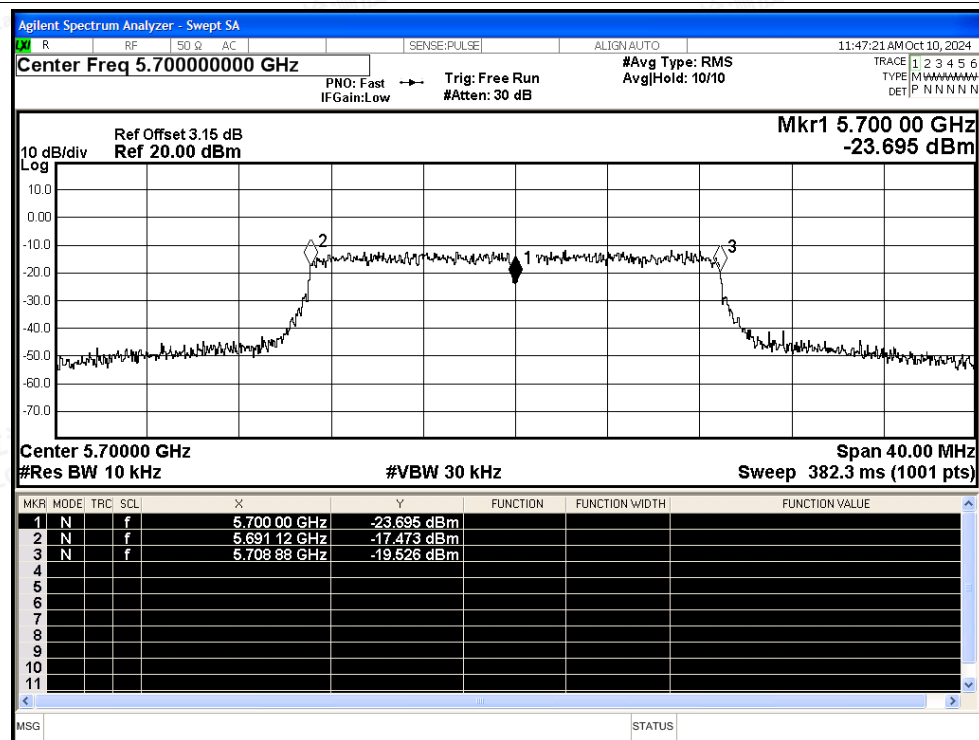




Freq. Stability NVNT ax40 5510MHz Ant1

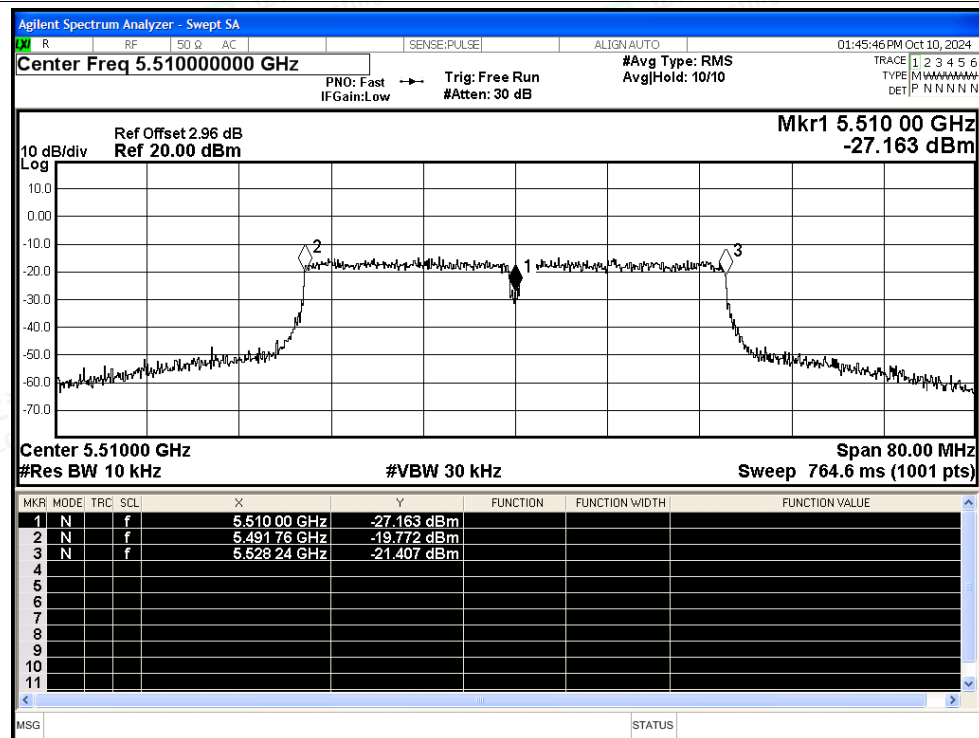


Freq. Stability NVNT ax40 5550MHz Ant1

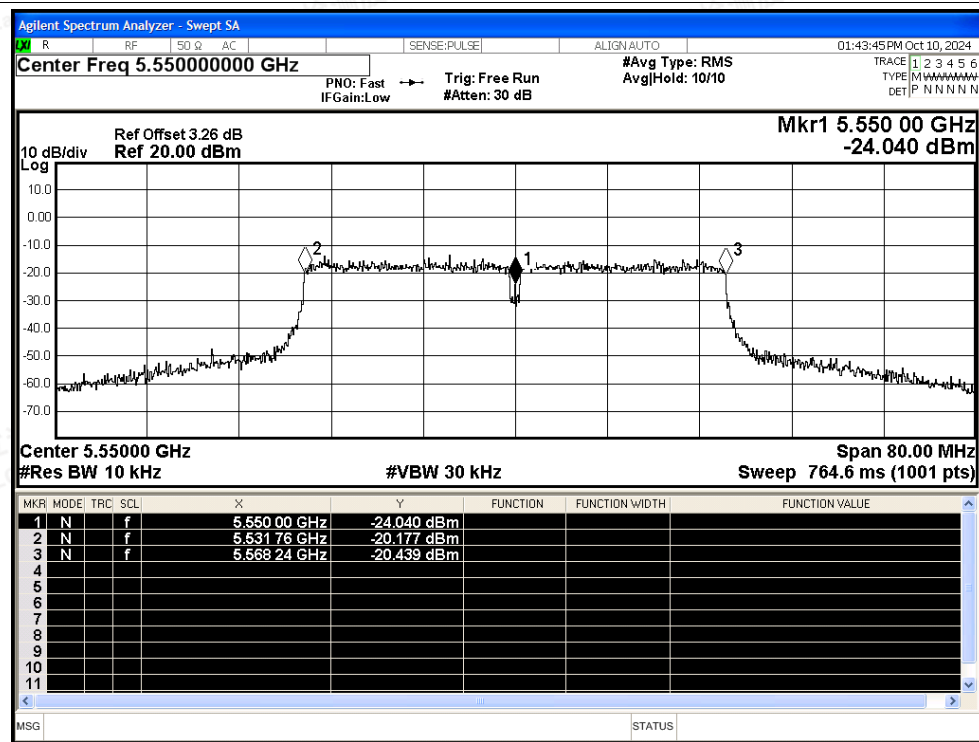





Freq. Stability NVNT ax40 5670MHz Ant1

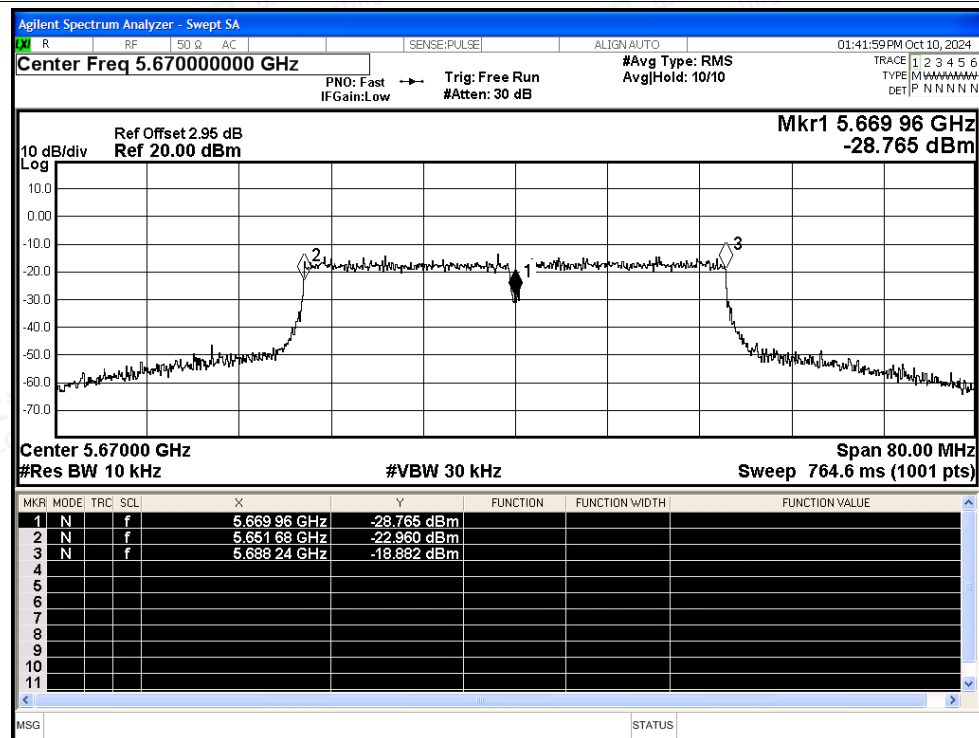

Freq. Stability NVNT ax80 5530MHz Ant1

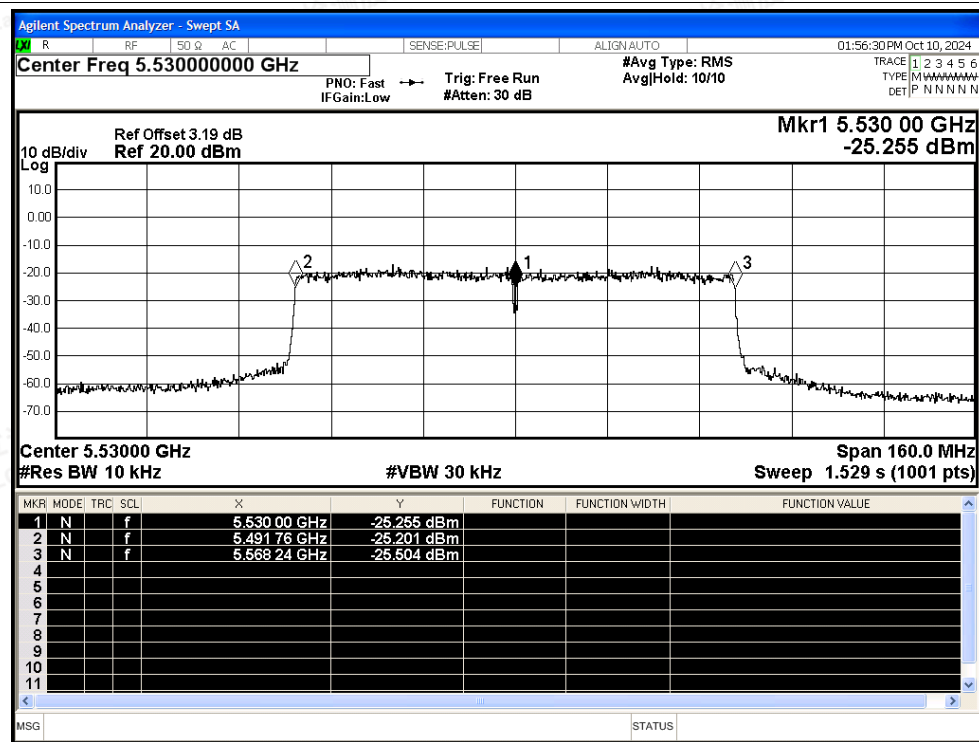

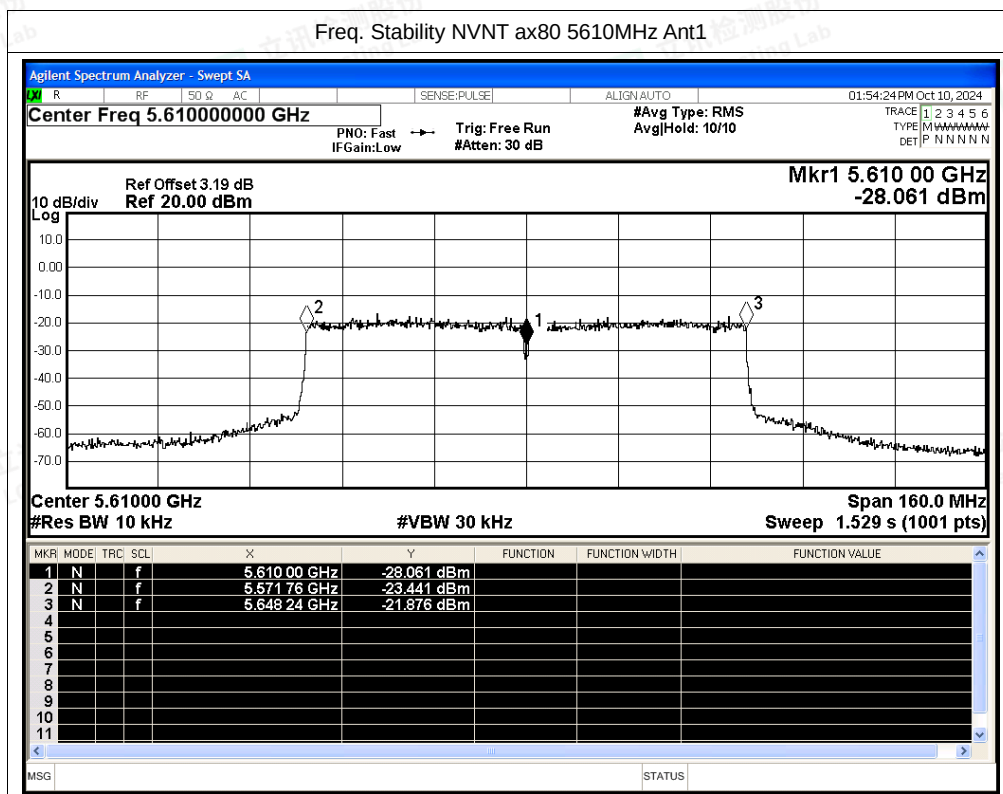

Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity



Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant2	5500	0	0	25	Pass
NVNT	a	5580	Ant2	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant2	5700	0	0	25	Pass
NVNT	n20	5500	Ant2	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant2	5579.96	-40000	-7.17	25	Pass
NVNT	n20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant2	5510	0	0	25	Pass
NVNT	n40	5550	Ant2	5550	0	0	25	Pass
NVNT	n40	5670	Ant2	5669.96	-40000	-7.05	25	Pass
NVNT	ac20	5500	Ant2	5500	0	0	25	Pass
NVNT	ac20	5580	Ant2	5580	0	0	25	Pass
NVNT	ac20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant2	5510	0	0	25	Pass
NVNT	ac40	5550	Ant2	5550	0	0	25	Pass
NVNT	ac40	5670	Ant2	5670	0	0	25	Pass
NVNT	ac80	5530	Ant2	5530	0	0	25	Pass
NVNT	ac80	5610	Ant2	5610	0	0	25	Pass
NVNT	ac160	5570	Ant2	5570	0	0	25	Pass
NVNT	ax160	5570	Ant2	5570	0	0	25	Pass
NVNT	ax20	5500	Ant2	5500.02	20000	3.64	25	Pass
NVNT	ax20	5580	Ant2	5579.96	-40000	-7.17	25	Pass
NVNT	ax20	5700	Ant2	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant2	5509.96	-40000	-7.26	25	Pass
NVNT	ax40	5550	Ant2	5549.96	-40000	-7.21	25	Pass
NVNT	ax40	5670	Ant2	5670	0	0	25	Pass
NVNT	ax80	5530	Ant2	5530	0	0	25	Pass
NVNT	ax80	5610	Ant2	5610	0	0	25	Pass




Shenzhen LCS Compliance Testing Laboratory Ltd.
Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street,
Baoan District, Shenzhen, 518000, China
Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com
Scan code to check authenticity




Test Graphs

Freq. Stability NVNT a 5500MHz Ant2

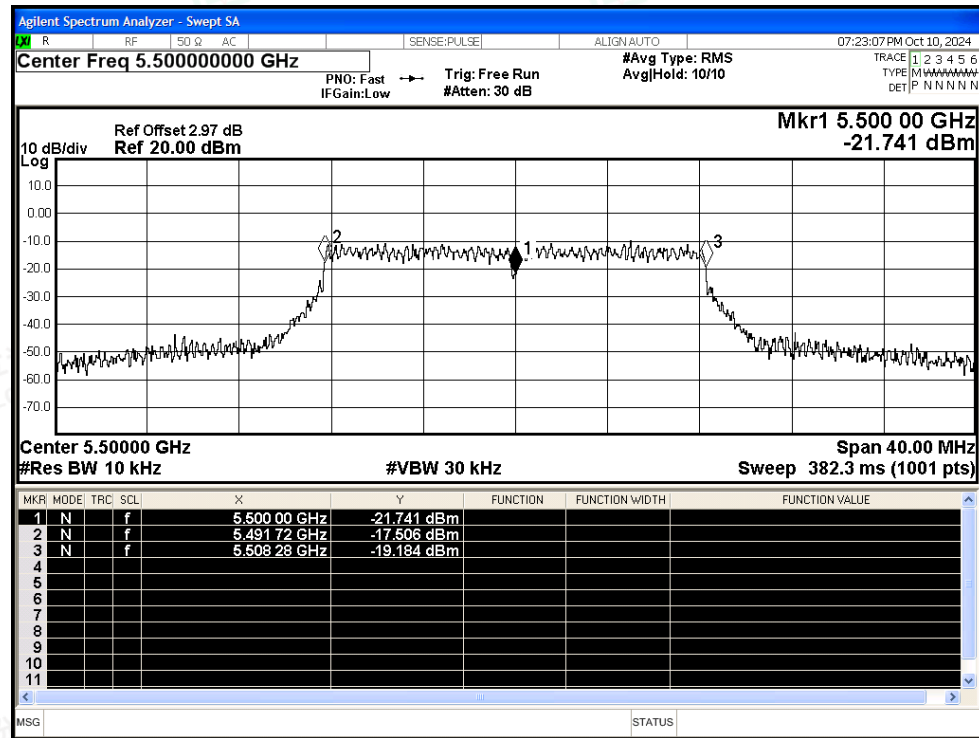


Freq. Stability NVNT a 5580MHz Ant2

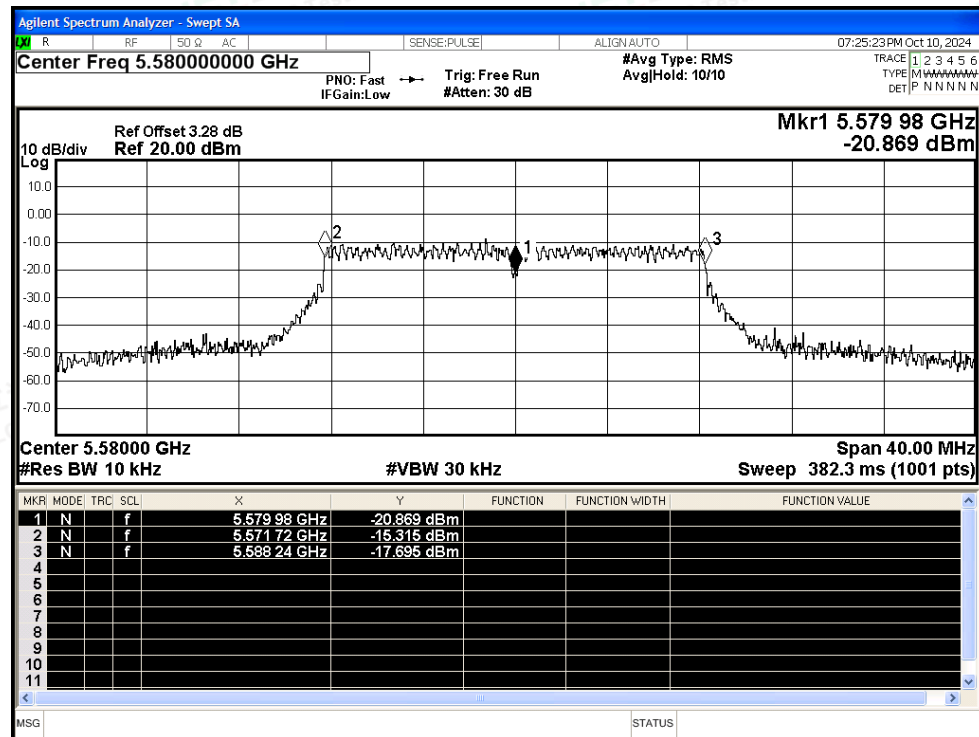



Freq. Stability NVNT a 5700MHz Ant2

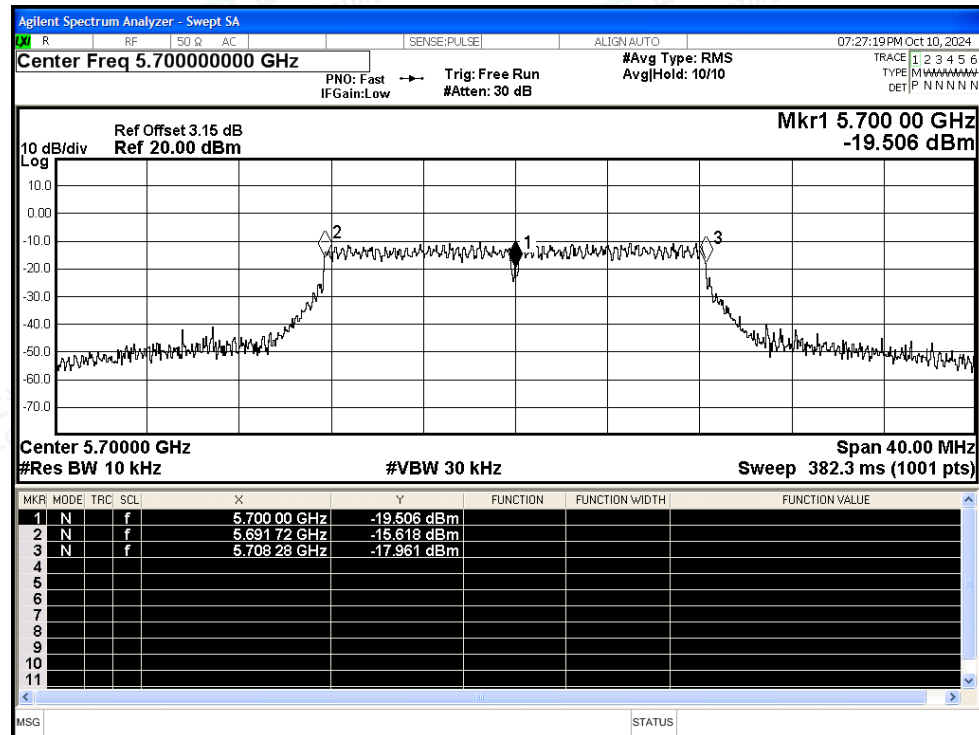

Freq. Stability NVNT n20 5500MHz Ant2

