


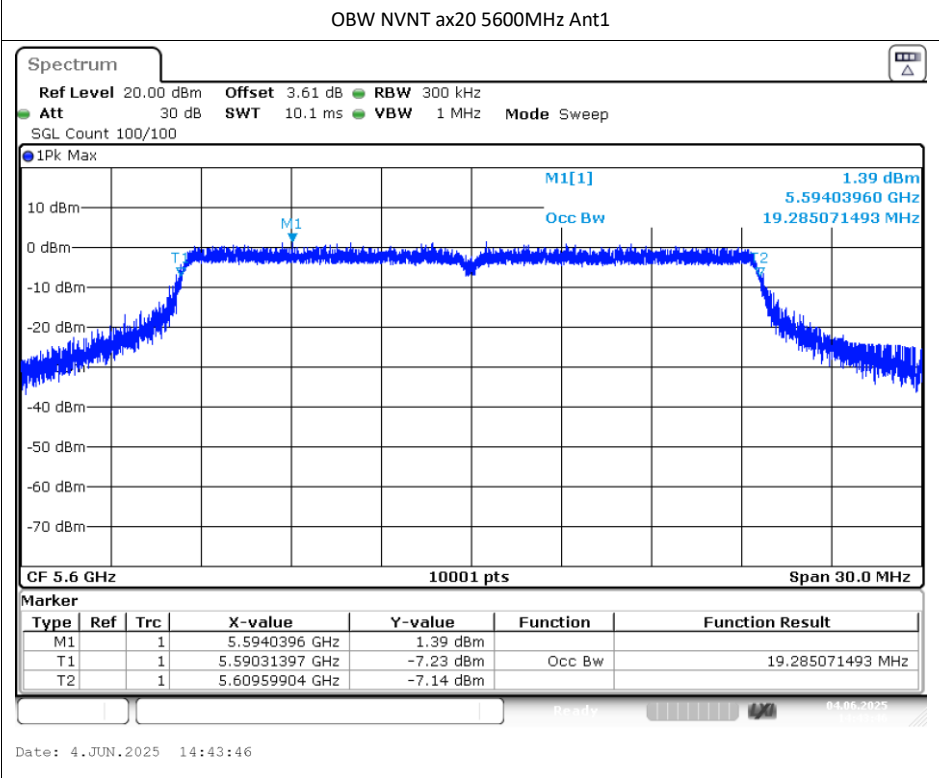



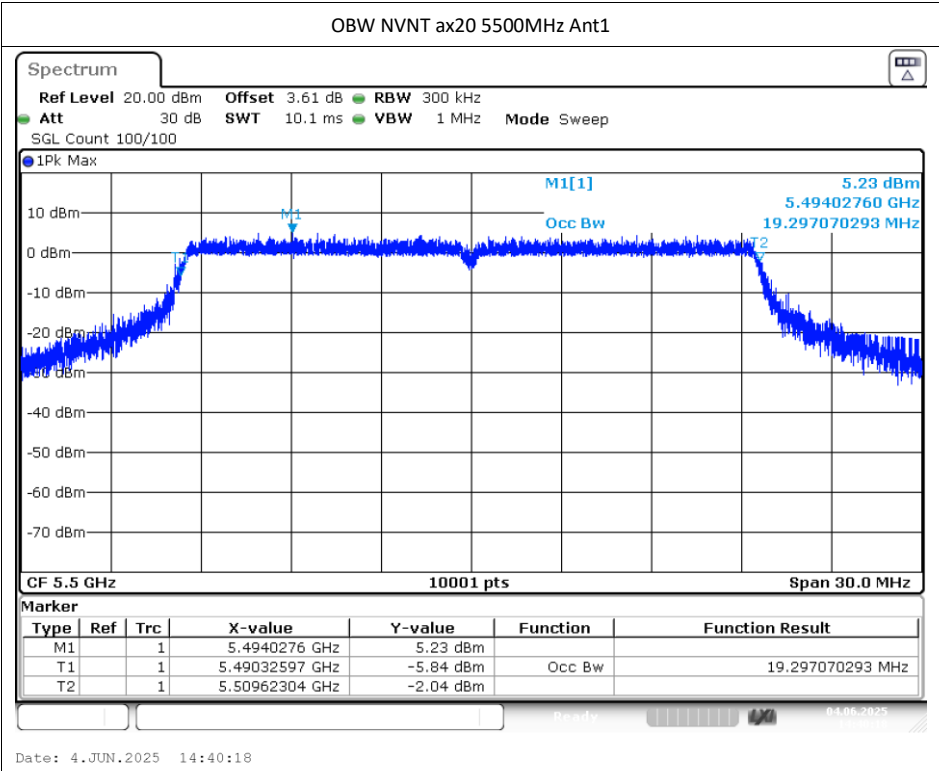




OBW NVNT ax20 5700MHz Ant1


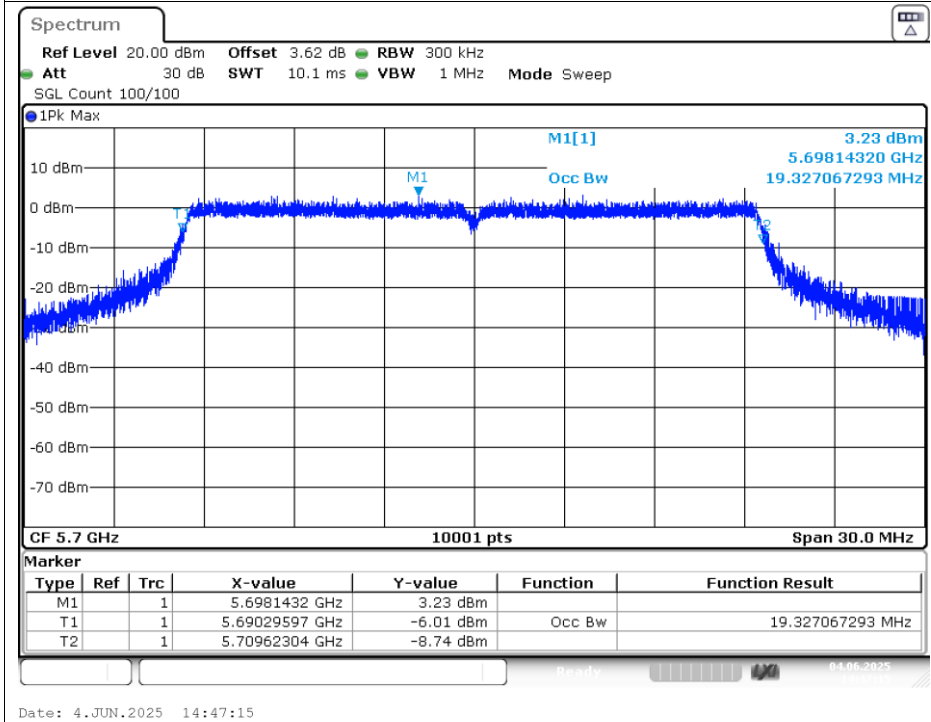




OBW NVNT ax20 5745MHz Ant1


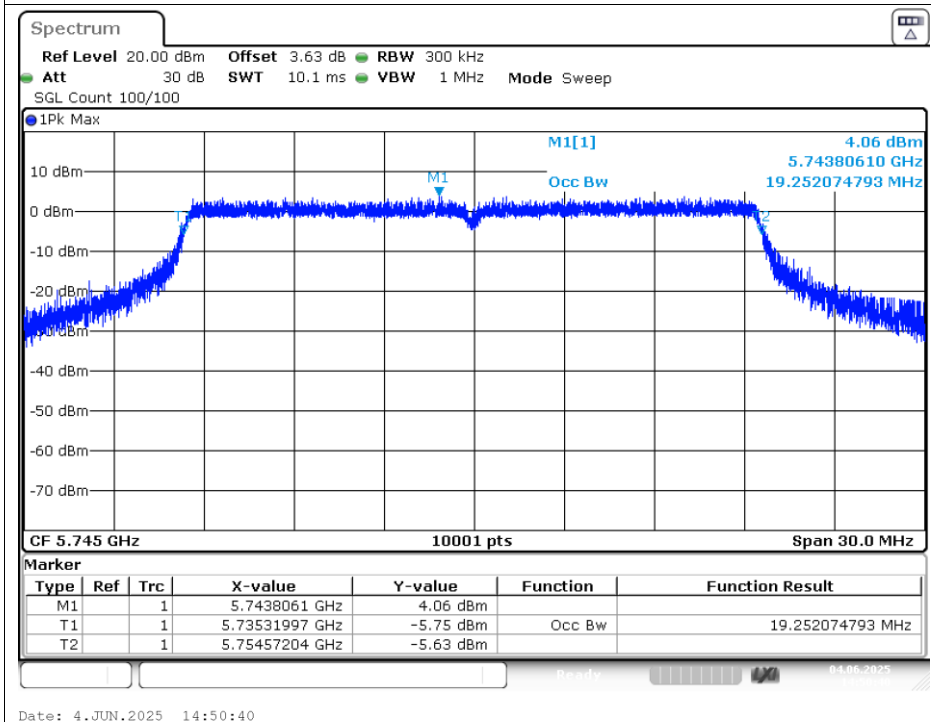


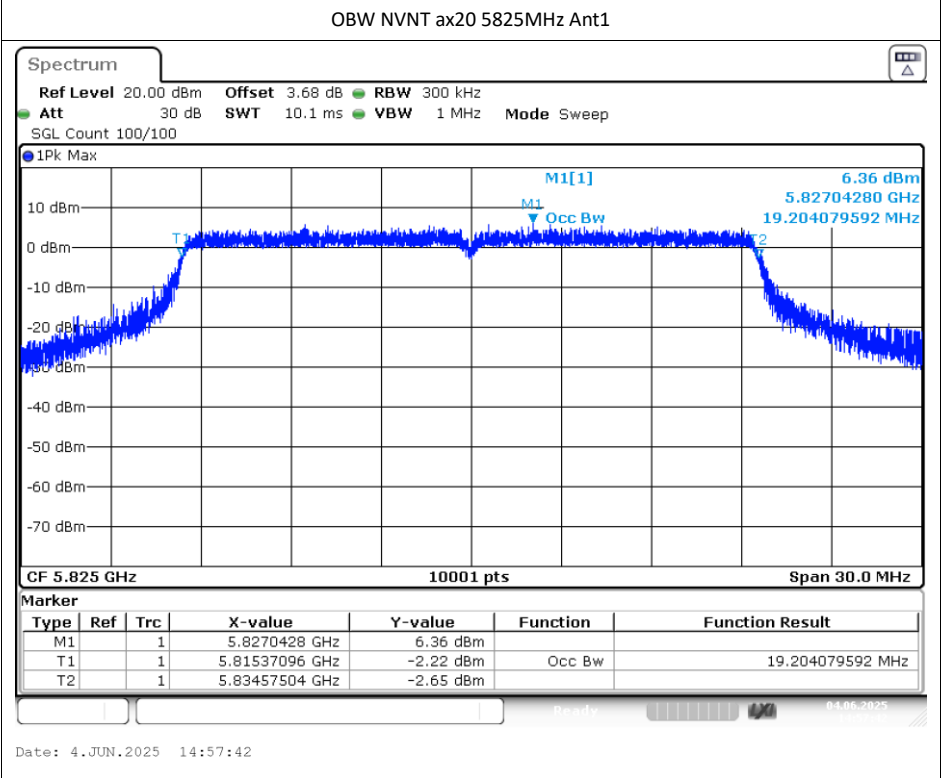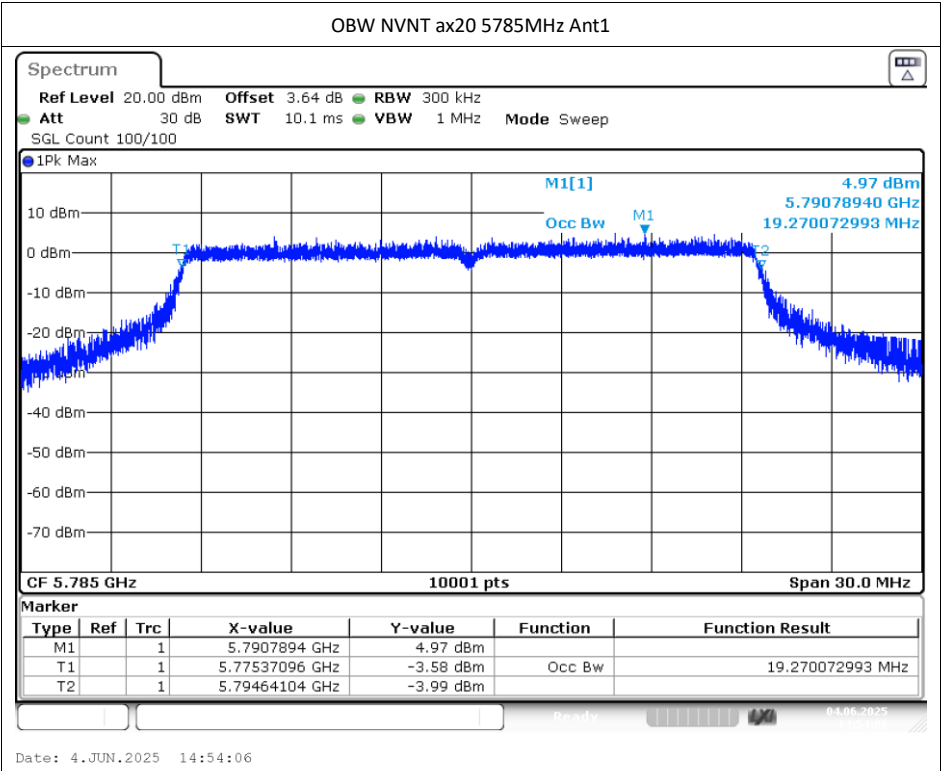


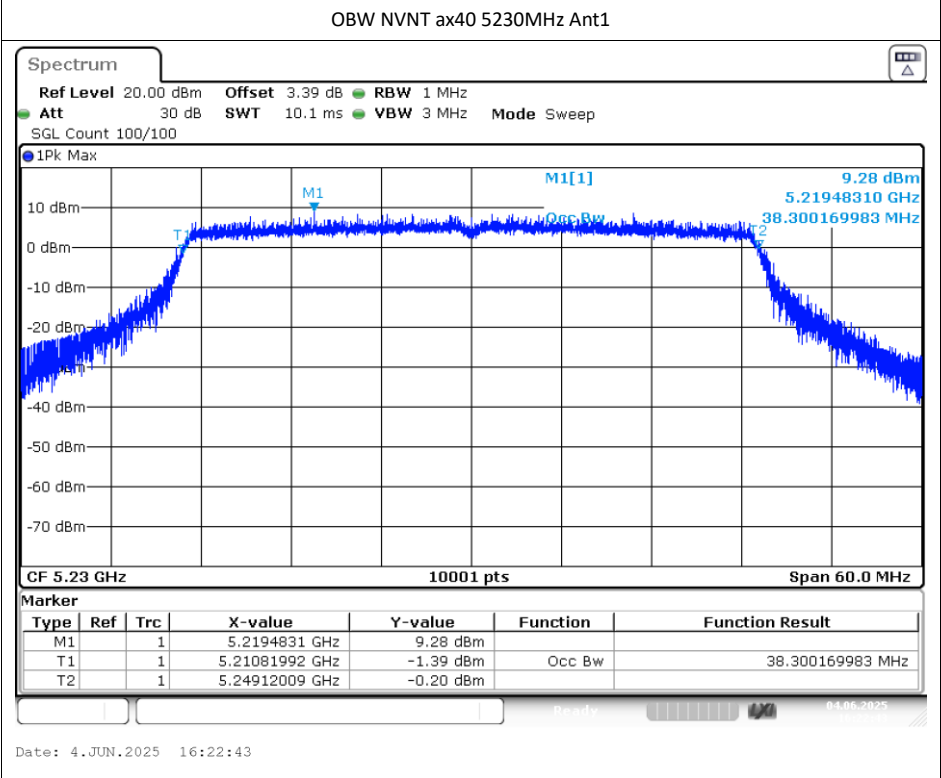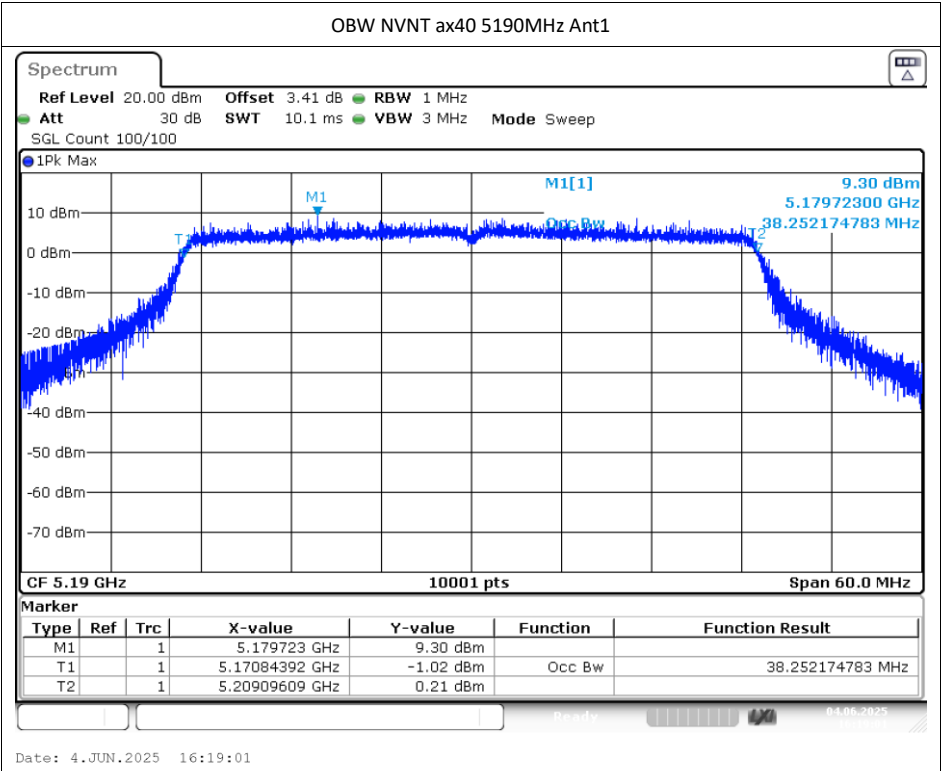

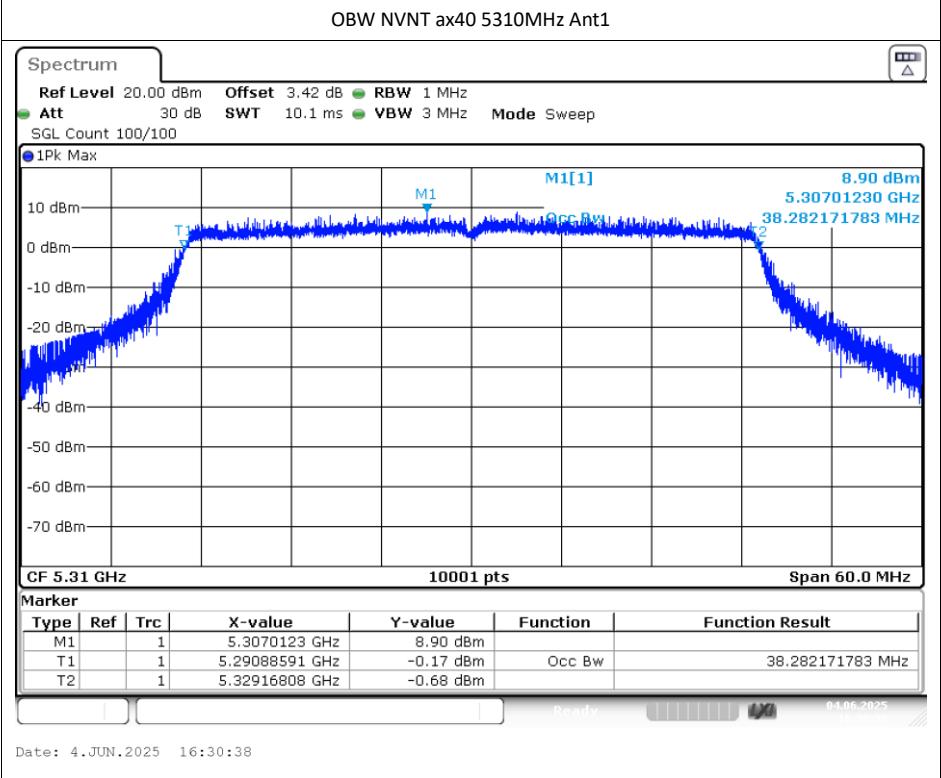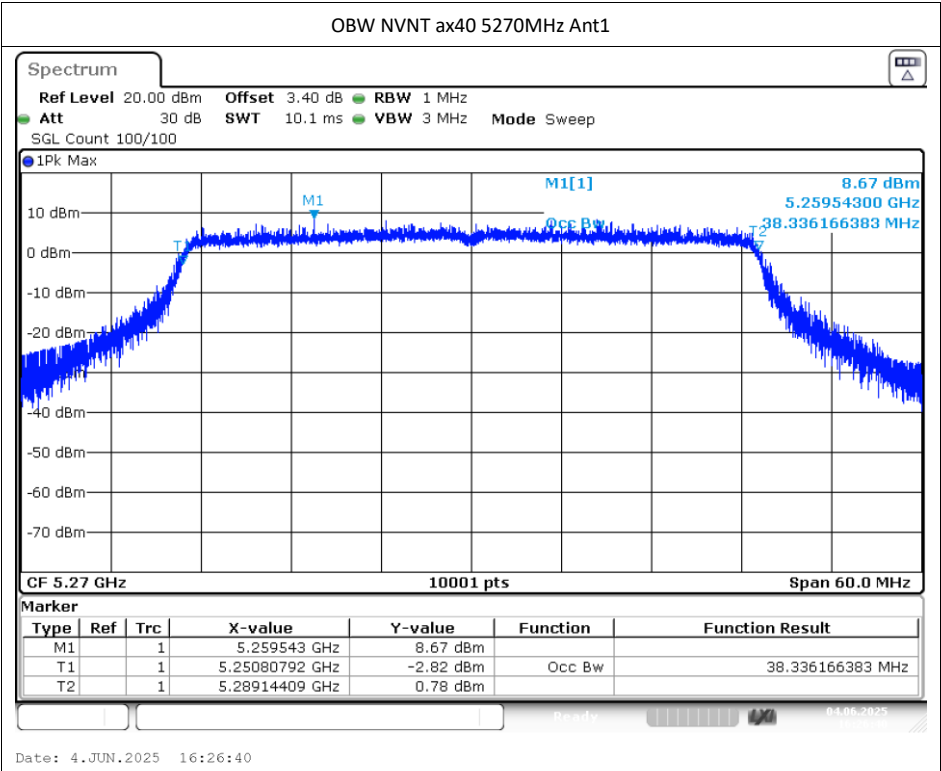

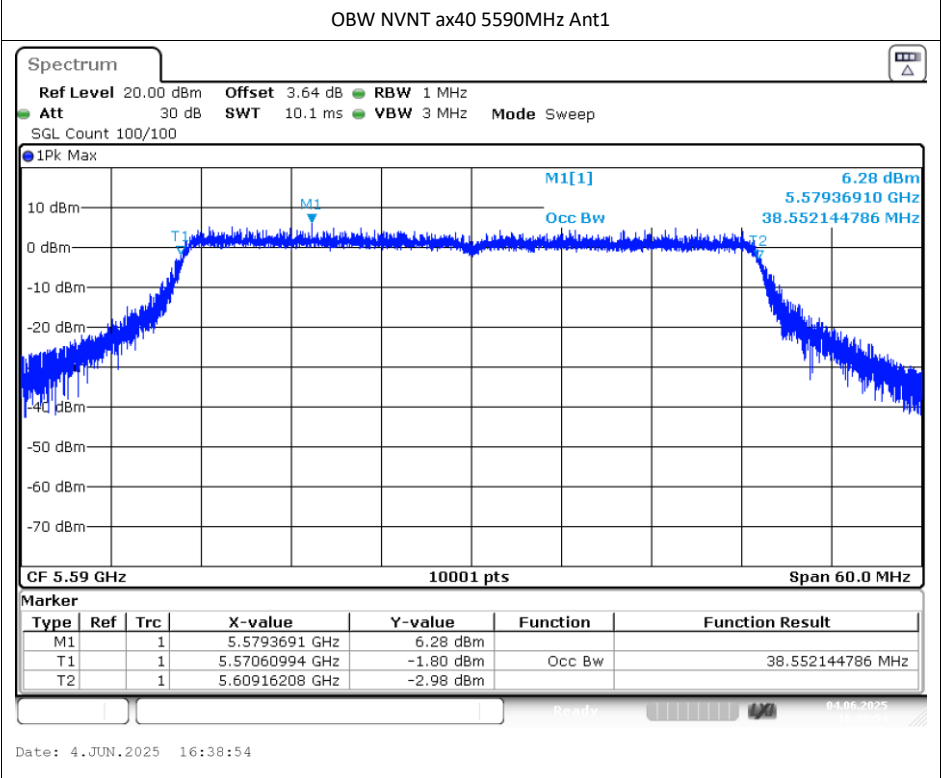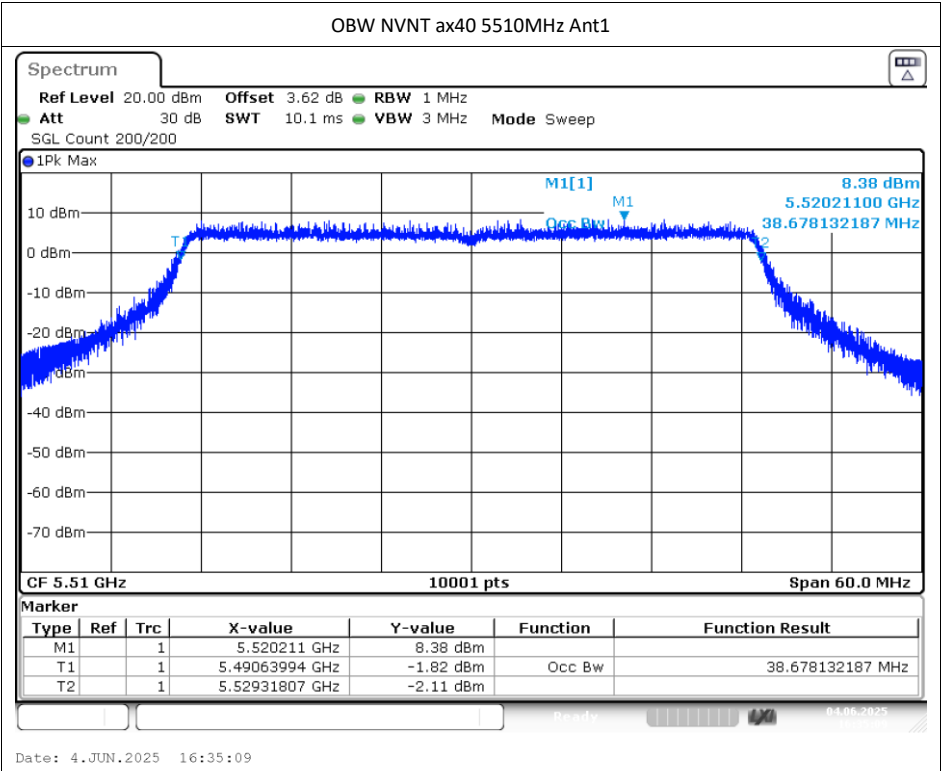

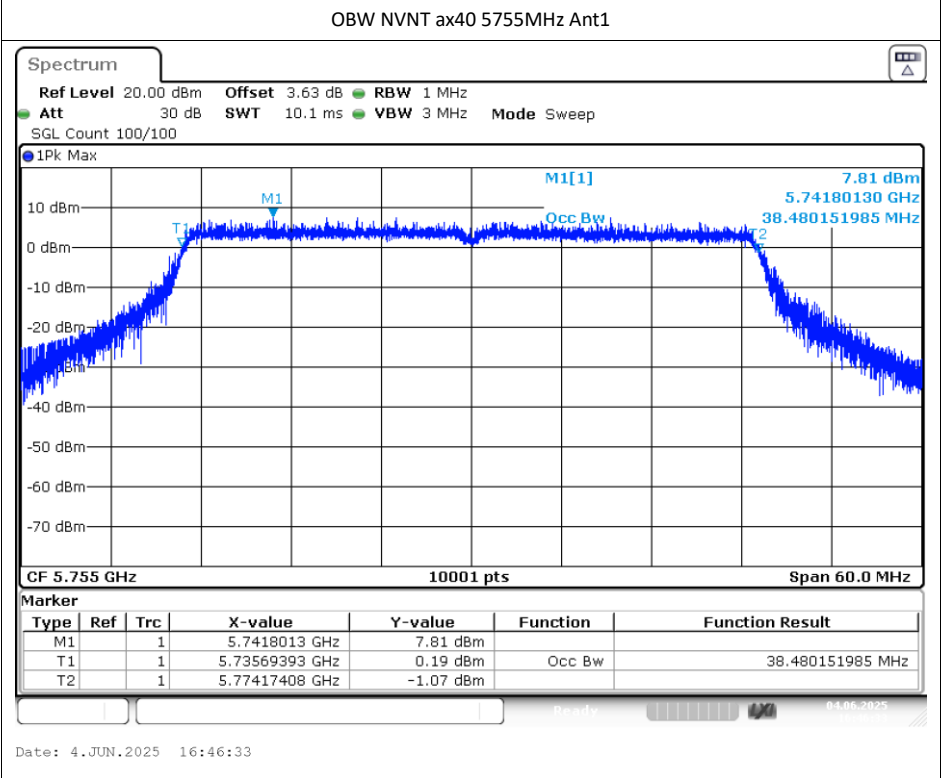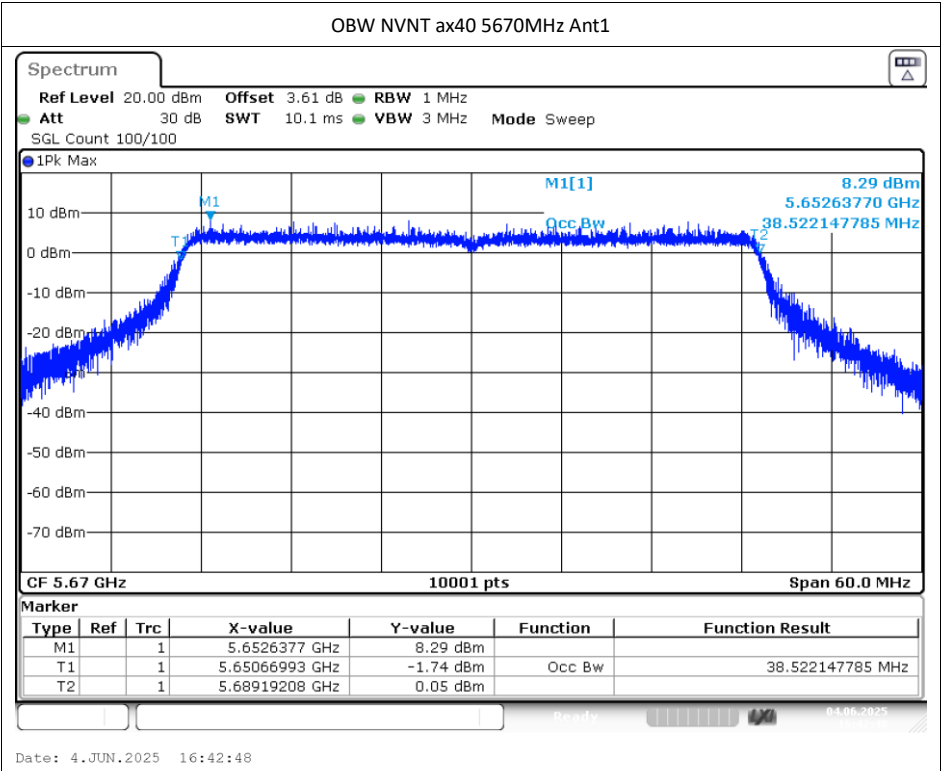

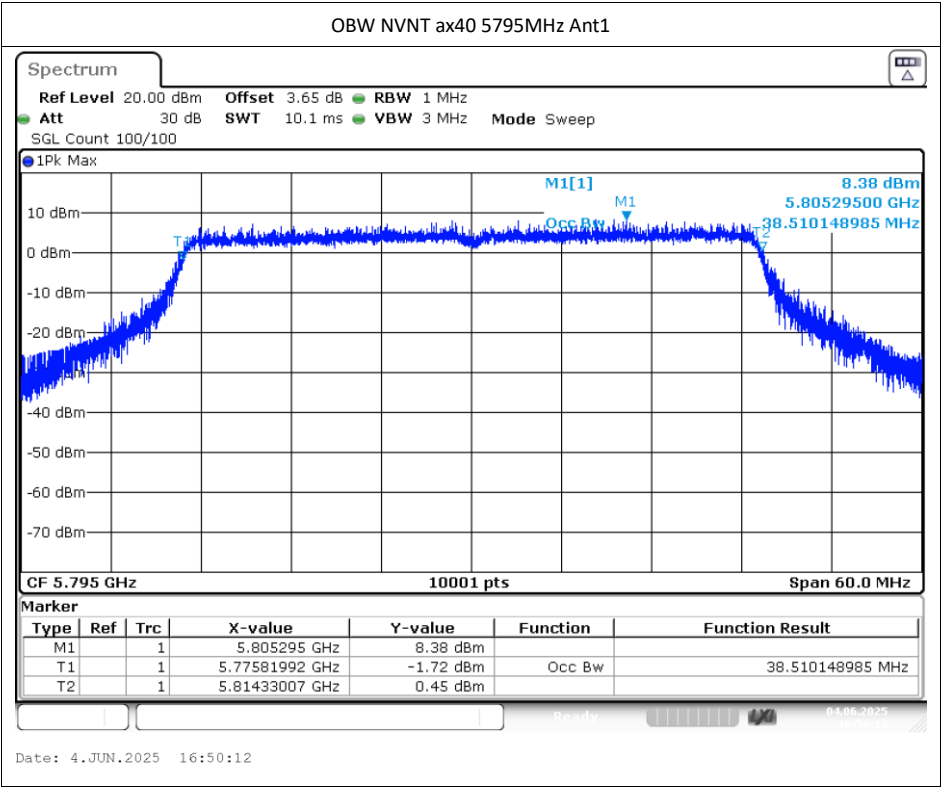

Maximum Power Spectral Density Level

Condition	Mode	Frequency (MHz)	Antenna	Conducted PSD (dBm)	Duty Factor (dB)	Total PSD (dBm)	Limit (dBm)	Verdict
NVNT	a	5180	Ant1	0.14	0.27	0.41	11	Pass
NVNT	a	5200	Ant1	-1.03	0.25	-0.78	11	Pass
NVNT	a	5240	Ant1	-0.78	0.47	-0.31	11	Pass
NVNT	a	5260	Ant1	-1.14	0.31	-0.83	11	Pass
NVNT	a	5280	Ant1	-0.55	0.43	-0.12	11	Pass
NVNT	a	5320	Ant1	-0.24	0.49	0.25	11	Pass
NVNT	a	5500	Ant1	-0.79	0.25	-0.54	11	Pass
NVNT	a	5600	Ant1	-4.71	0.39	-4.32	11	Pass
NVNT	a	5700	Ant1	-2.21	0.27	-1.94	11	Pass
NVNT	a	5745	Ant1	-7.84	0.25	-7.59	30	Pass
NVNT	a	5785	Ant1	-5.14	0.25	-4.89	30	Pass
NVNT	a	5825	Ant1	-2.8	0.27	-2.53	30	Pass
NVNT	n20	5180	Ant1	-1.74	0.48	-1.26	11	Pass
NVNT	n20	5200	Ant1	-0.96	0.31	-0.65	11	Pass
NVNT	n20	5240	Ant1	-2.13	0.27	-1.86	11	Pass
NVNT	n20	5260	Ant1	-2.5	0.42	-2.08	11	Pass
NVNT	n20	5280	Ant1	-1.6	0.46	-1.14	11	Pass
NVNT	n20	5320	Ant1	-1.83	0.44	-1.39	11	Pass
NVNT	n20	5500	Ant1	-2.43	0.5	-1.93	11	Pass
NVNT	n20	5600	Ant1	-2.73	0.29	-2.44	11	Pass
NVNT	n20	5700	Ant1	-2.14	0.4	-1.74	11	Pass
NVNT	n20	5745	Ant1	-7.88	0.31	-7.57	30	Pass
NVNT	n20	5785	Ant1	-6.45	0.29	-6.16	30	Pass
NVNT	n20	5825	Ant1	-4.87	0.48	-4.39	30	Pass
NVNT	n40	5190	Ant1	-6.05	0.69	-5.36	11	Pass
NVNT	n40	5230	Ant1	-5.67	1	-4.67	11	Pass
NVNT	n40	5270	Ant1	-6.71	0.73	-5.98	11	Pass
NVNT	n40	5310	Ant1	-6.27	0.53	-5.74	11	Pass
NVNT	n40	5510	Ant1	-7.39	0.73	-6.66	11	Pass
NVNT	n40	5590	Ant1	-6.93	0.73	-6.2	11	Pass
NVNT	n40	5670	Ant1	-14.91	1.55	-13.36	11	Pass
NVNT	n40	5755	Ant1	-10.77	0.77	-10	30	Pass
NVNT	n40	5795	Ant1	-10.28	0.69	-9.59	30	Pass
NVNT	ac20	5180	Ant1	-1.38	0.39	-0.99	11	Pass
NVNT	ac20	5200	Ant1	-1.32	0.31	-1.01	11	Pass
NVNT	ac20	5240	Ant1	-1.7	0.27	-1.43	11	Pass
NVNT	ac20	5260	Ant1	-2.44	0.27	-2.17	11	Pass
NVNT	ac20	5280	Ant1	-2.67	0.39	-2.28	11	Pass
NVNT	ac20	5320	Ant1	-2.25	0.27	-1.98	11	Pass

NVNT	ac20	5500	Ant1	-2.74	0.52	-2.22	11	Pass
NVNT	ac20	5600	Ant1	-2.07	0.62	-1.45	11	Pass
NVNT	ac20	5700	Ant1	-2.67	0.52	-2.15	11	Pass
NVNT	ac20	5745	Ant1	-11.94	0.27	-11.67	30	Pass
NVNT	ac20	5785	Ant1	-5.39	0.27	-5.12	30	Pass
NVNT	ac20	5825	Ant1	-3.9	0.46	-3.44	30	Pass
NVNT	ac40	5190	Ant1	-7.69	0.48	-7.21	11	Pass
NVNT	ac40	5230	Ant1	-6.35	0.76	-5.59	11	Pass
NVNT	ac40	5270	Ant1	-6.67	0.84	-5.83	11	Pass
NVNT	ac40	5310	Ant1	-7.92	0.48	-7.44	11	Pass
NVNT	ac40	5510	Ant1	-5.77	1.6	-4.17	11	Pass
NVNT	ac40	5590	Ant1	-13.87	0.48	-13.39	11	Pass
NVNT	ac40	5670	Ant1	-12.58	0.48	-12.1	11	Pass
NVNT	ac40	5755	Ant1	-11.22	0.48	-10.74	30	Pass
NVNT	ac40	5795	Ant1	-9.75	0.6	-9.15	30	Pass
NVNT	ax20	5180	Ant1	-1.88	0.34	-1.54	11	Pass
NVNT	ax20	5200	Ant1	-2.34	0.34	-2	11	Pass
NVNT	ax20	5240	Ant1	-2.51	0.37	-2.14	11	Pass
NVNT	ax20	5260	Ant1	-3.74	0.34	-3.4	11	Pass
NVNT	ax20	5280	Ant1	-4.34	0.64	-3.7	11	Pass
NVNT	ax20	5320	Ant1	-2.27	0.32	-1.95	11	Pass
NVNT	ax20	5500	Ant1	-2.37	0.4	-1.97	11	Pass
NVNT	ax20	5600	Ant1	-3.87	0.64	-3.23	11	Pass
NVNT	ax20	5700	Ant1	-3.79	0.4	-3.39	11	Pass
NVNT	ax20	5745	Ant1	-6.82	0.34	-6.48	30	Pass
NVNT	ax20	5785	Ant1	-5.8	0.34	-5.46	30	Pass
NVNT	ax20	5825	Ant1	-6.39	0.37	-6.02	30	Pass
NVNT	ax40	5190	Ant1	-8.45	0.88	-7.57	11	Pass
NVNT	ax40	5230	Ant1	-8.24	0.64	-7.6	11	Pass
NVNT	ax40	5270	Ant1	-7.42	0.97	-6.45	11	Pass
NVNT	ax40	5310	Ant1	-8.31	0.64	-7.67	11	Pass
NVNT	ax40	5510	Ant1	-17.31	0.64	-16.67	11	Pass
NVNT	ax40	5590	Ant1	-9.56	1.91	-7.65	11	Pass
NVNT	ax40	5670	Ant1	-9.33	1.72	-7.61	11	Pass
NVNT	ax40	5755	Ant1	-11.62	0.88	-10.74	30	Pass
NVNT	ax40	5795	Ant1	-10.55	0.78	-9.77	30	Pass

