




NVNT	ac20	5180	Ant2	4500	-49.24	2.12	-	48.11	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	4500	-57.89	2.12	0.12	39.58	Average	54	Pass
NVNT	ac20	5180	Ant2	5148.9	-40.96	2.12	-	56.39	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5148.2	-52.67	2.12	0.12	44.80	Average	54	Pass
NVNT	ac20	5180	Ant2	5150	-41.51	2.12	-	55.84	Peak	68.2	Pass
NVNT	ac20	5180	Ant2	5150	-52.22	2.12	0.12	45.25	Average	54	Pass
NVNT	ac20	5240	Ant2	5350	-47.62	2.12	-	49.73	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5350	-56.74	2.12	0.12	40.73	Average	54	Pass
NVNT	ac20	5240	Ant2	5399.76	-46.47	2.12	-	50.88	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5351.04	-55.9	2.12	0.12	41.57	Average	54	Pass
NVNT	ac20	5240	Ant2	5460	-49.69	2.12	-	47.66	Peak	68.2	Pass
NVNT	ac20	5240	Ant2	5460	-57.23	2.12	0.12	40.24	Average	54	Pass
NVNT	ac40	5190	Ant2	4500	-49.31	2.12	-	48.04	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	4500	-57.21	2.12	0.24	40.38	Average	54	Pass
NVNT	ac40	5190	Ant2	5149.7	-40.6	2.12	-	56.75	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5148.97	-52.37	2.12	0.24	45.22	Average	54	Pass
NVNT	ac40	5190	Ant2	5150	-40.6	2.12	-	56.75	Peak	68.2	Pass
NVNT	ac40	5190	Ant2	5150	-53.07	2.12	0.24	44.52	Average	54	Pass
NVNT	ac40	5230	Ant2	5350	-48.55	2.12	-	48.80	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5350	-56.48	2.12	0.24	41.11	Average	54	Pass
NVNT	ac40	5230	Ant2	5409.51	-46.4	2.12	-	50.95	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5354.43	-56.11	2.12	0.24	41.48	Average	54	Pass
NVNT	ac40	5230	Ant2	5460	-48.28	2.12	-	49.07	Peak	68.2	Pass
NVNT	ac40	5230	Ant2	5460	-56.71	2.12	0.24	40.88	Average	54	Pass
NVNT	ac80	5210	Ant2	5350	-47.26	2.12	-	50.09	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5350	-55.58	2.12	0.47	42.24	Average	54	Pass
NVNT	ac80	5210	Ant2	5363.97	-45.45	2.12	-	51.90	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5371.56	-55.44	2.12	0.47	42.38	Average	54	Pass
NVNT	ac80	5210	Ant2	5460	-47.96	2.12	-	49.39	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5460	-56.55	2.12	0.47	41.27	Average	54	Pass
NVNT	ac80	5210	Ant2	4500	-49.95	2.12	-	47.40	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	4500	-57.67	2.12	0.47	40.15	Average	54	Pass
NVNT	ac80	5210	Ant2	5145.43	-41.68	2.12	-	55.67	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5142.27	-51.83	2.12	0.47	45.99	Average	54	Pass
NVNT	ac80	5210	Ant2	5150	-42.63	2.12	-	54.72	Peak	68.2	Pass
NVNT	ac80	5210	Ant2	5150	-52.7	2.12	0.47	45.12	Average	54	Pass






Test Graphs

Restrict Band NVNT a 5180MHz Ant2 Peak

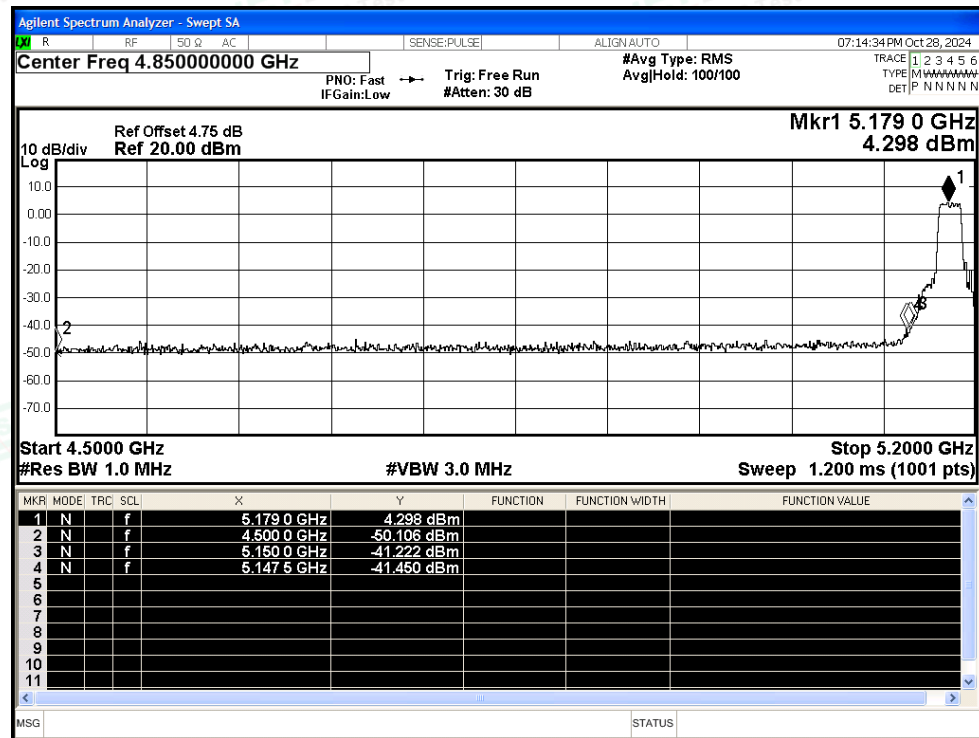

Restrict Band NVNT a 5180MHz Ant2 Average


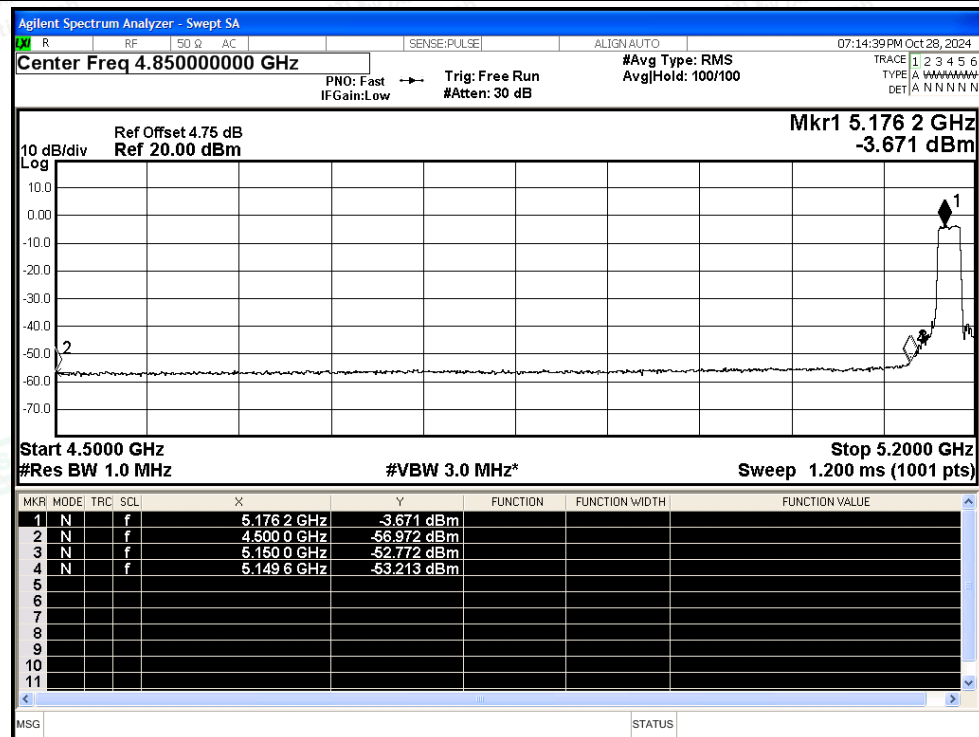


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

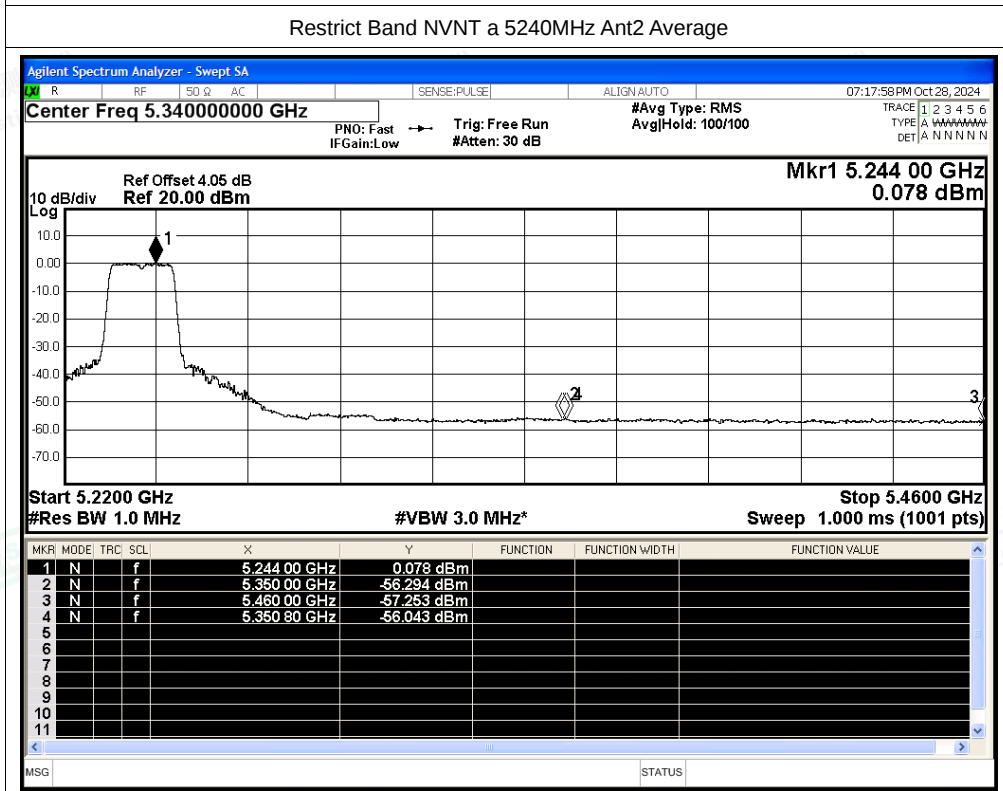
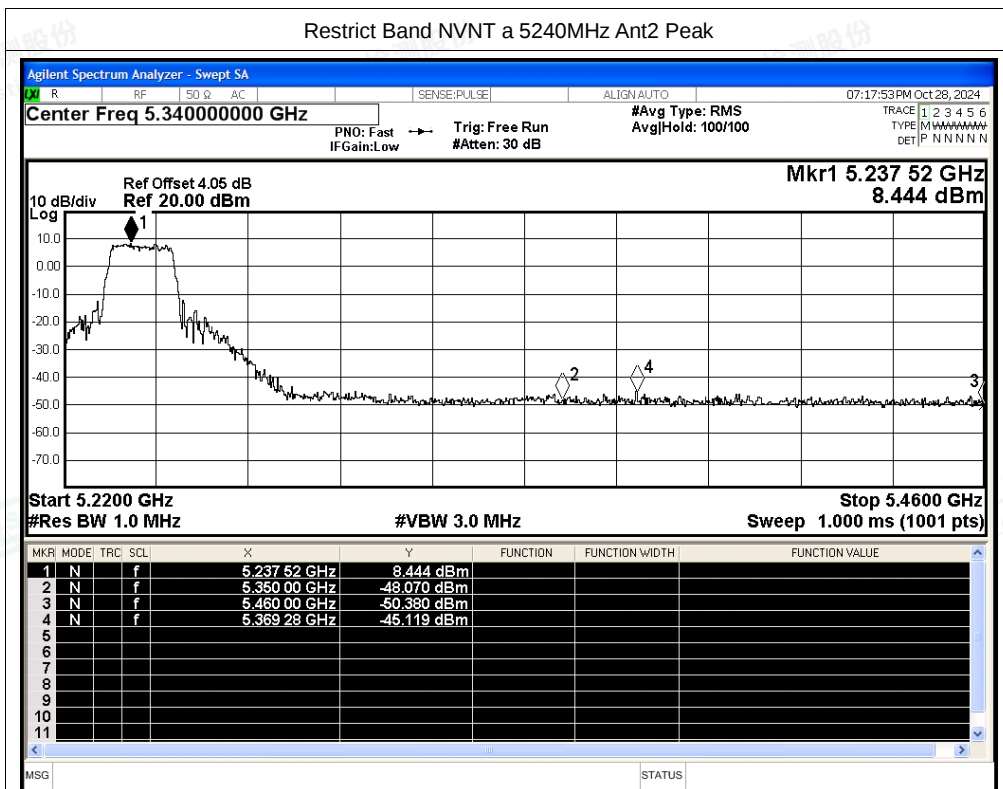


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

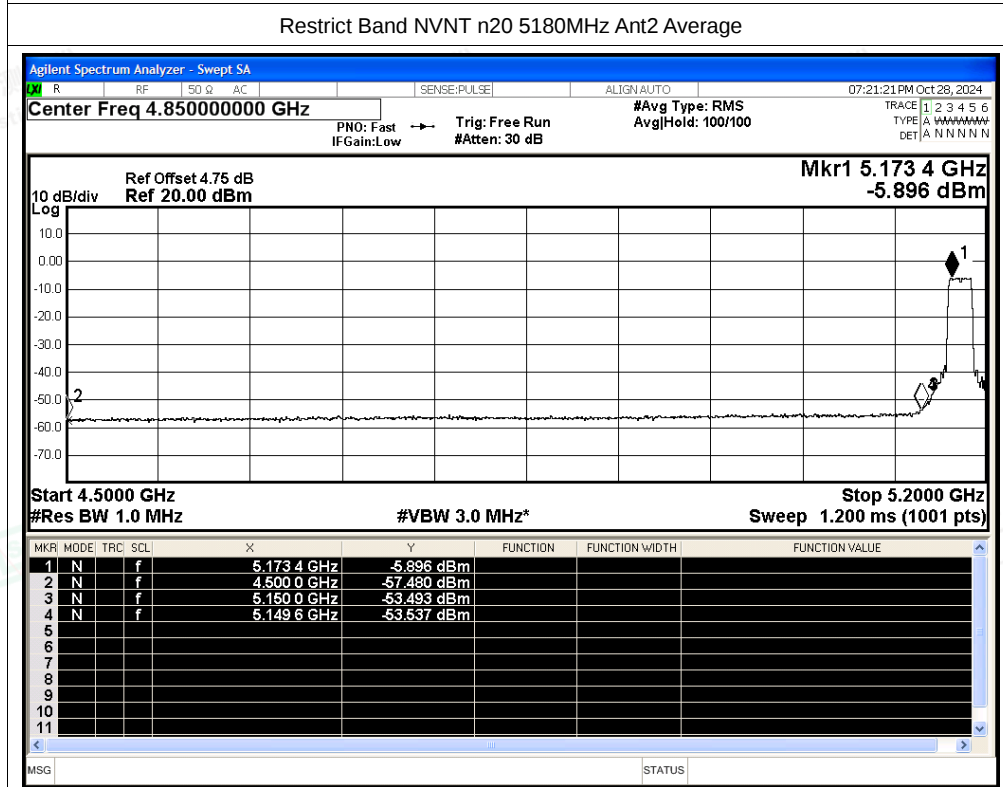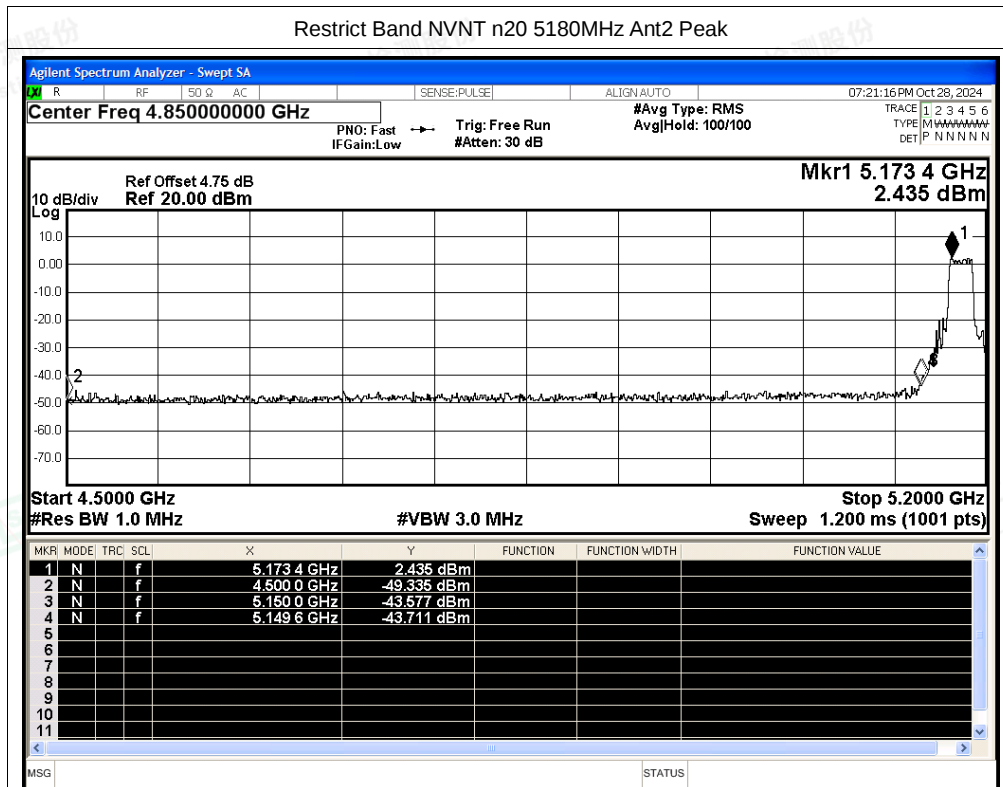

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





Restrict Band NVNT n20 5240MHz Ant2 Peak

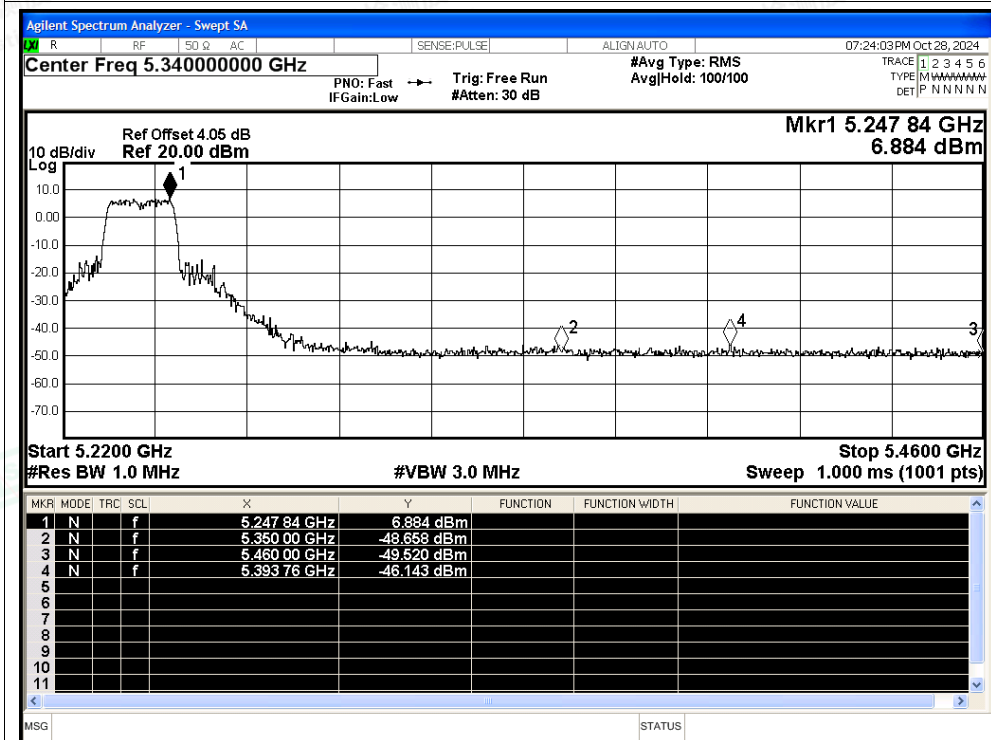

Restrict Band NVNT n20 5240MHz Ant2 Average

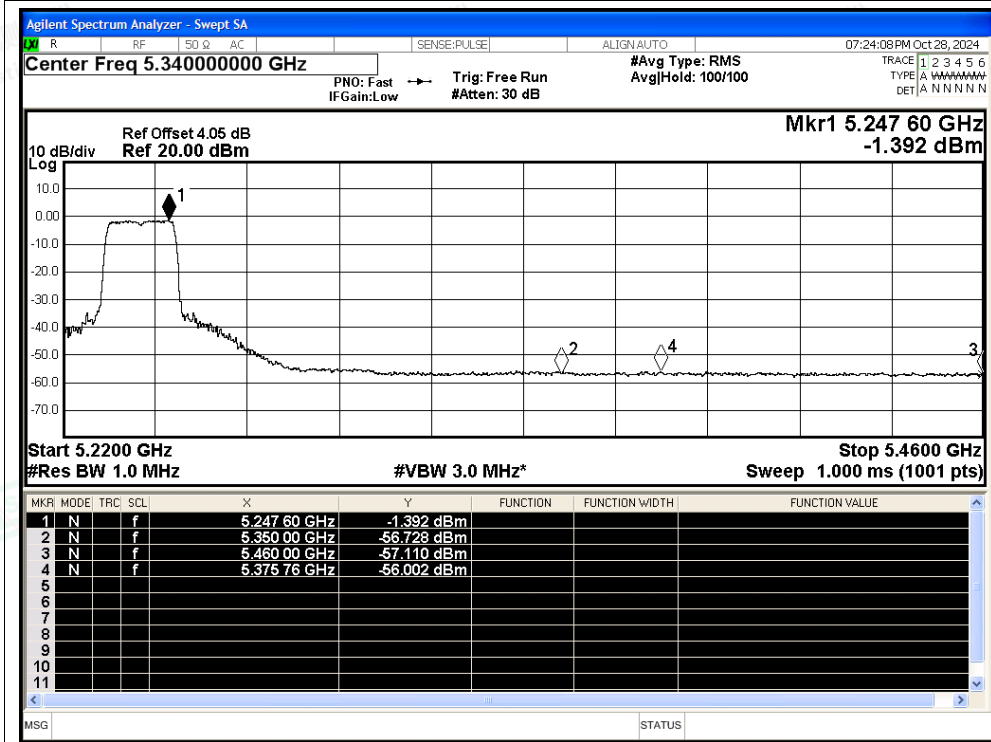

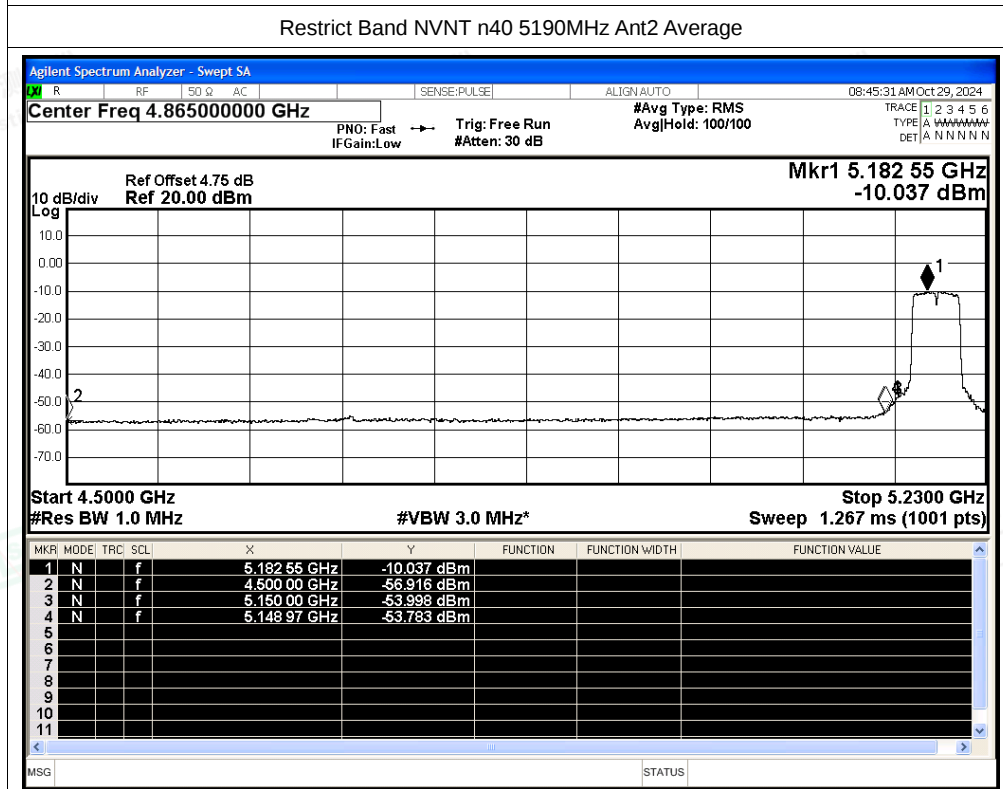
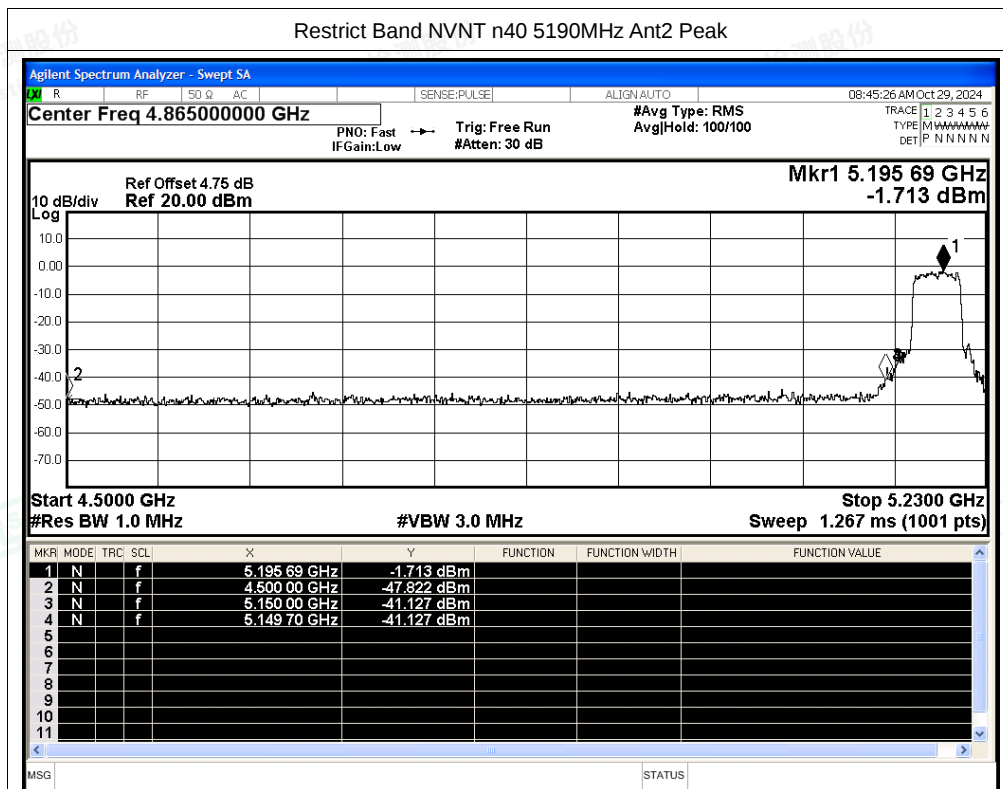


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

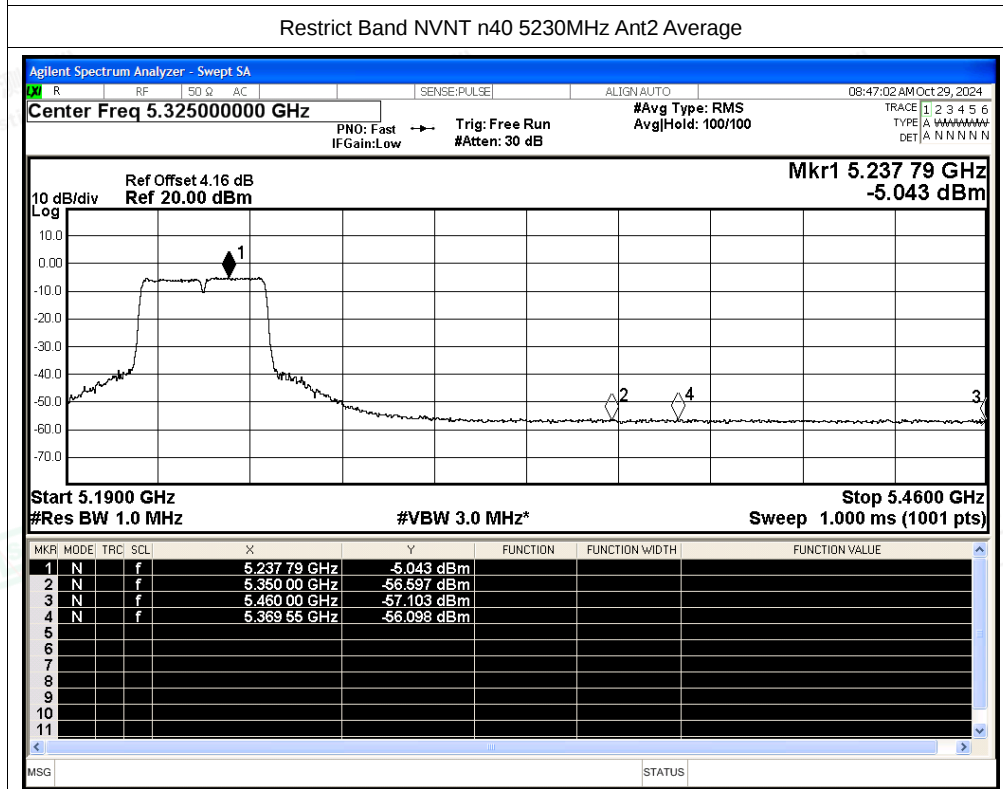
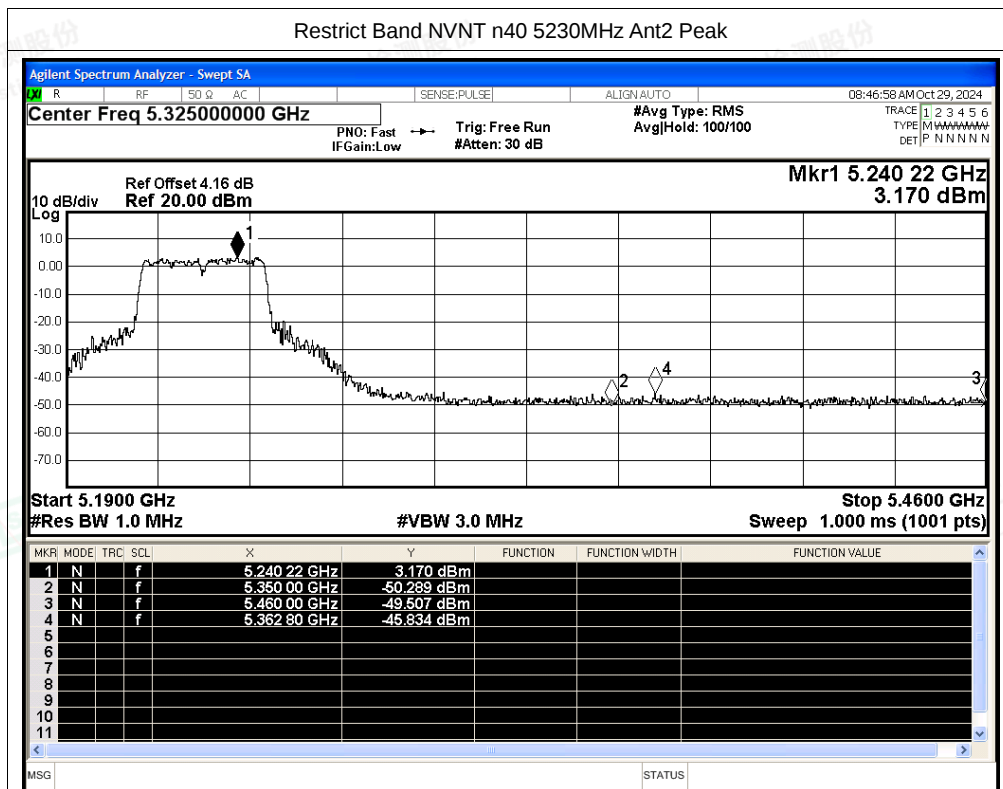


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

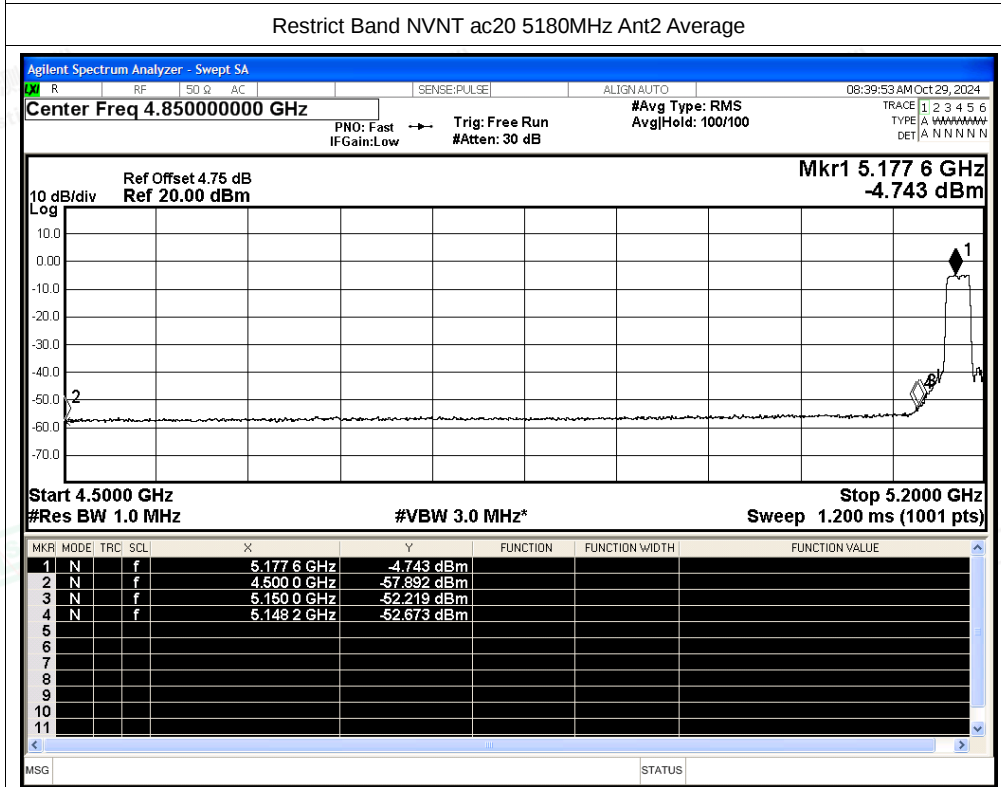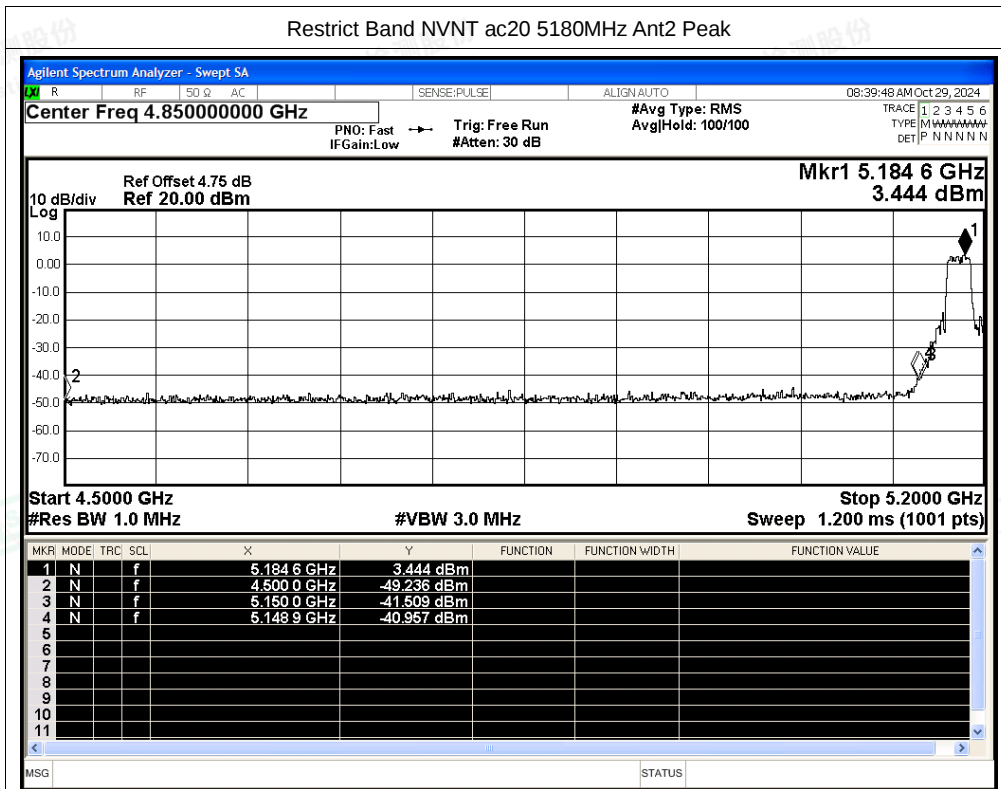

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





Restrict Band NVNT ac20 5240MHz Ant2 Peak

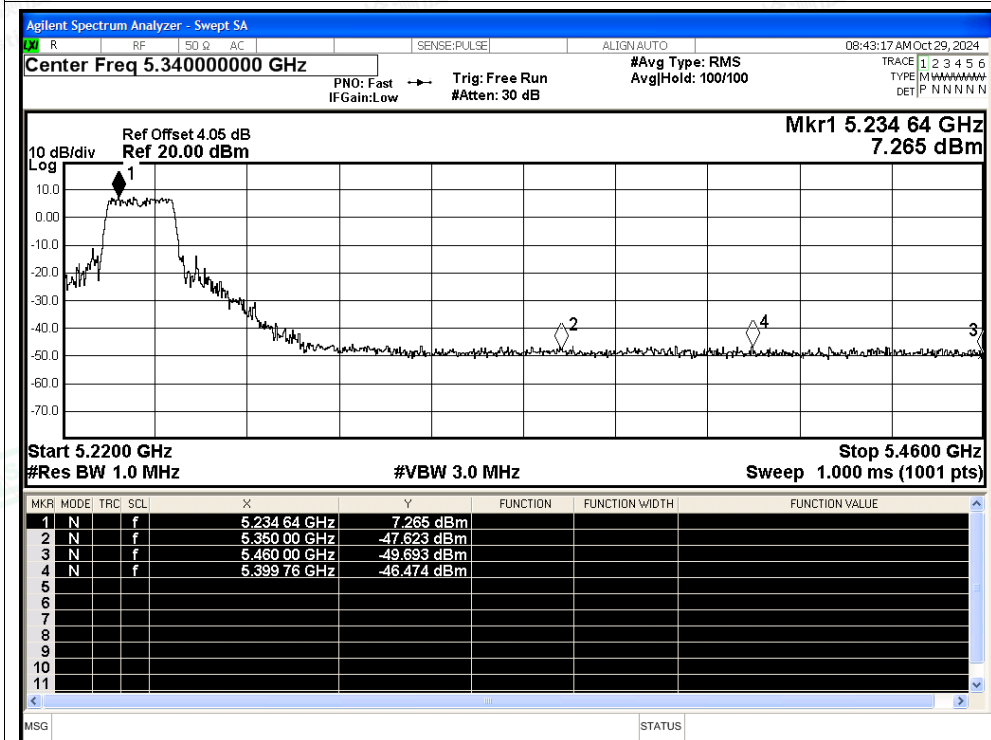

Restrict Band NVNT ac20 5240MHz Ant2 Average

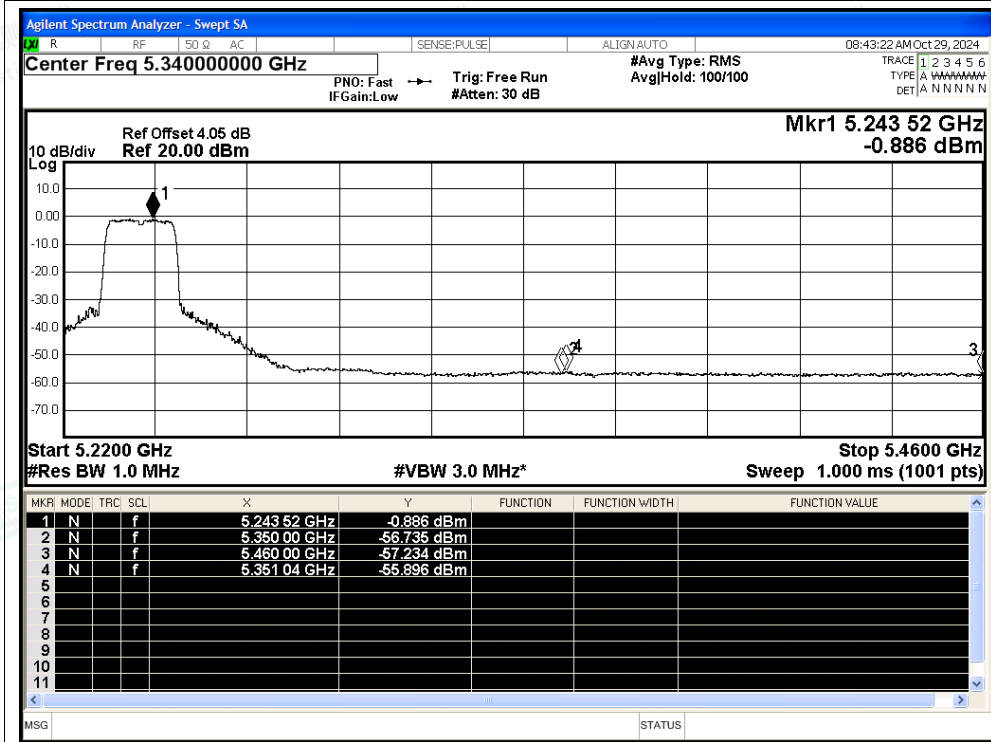

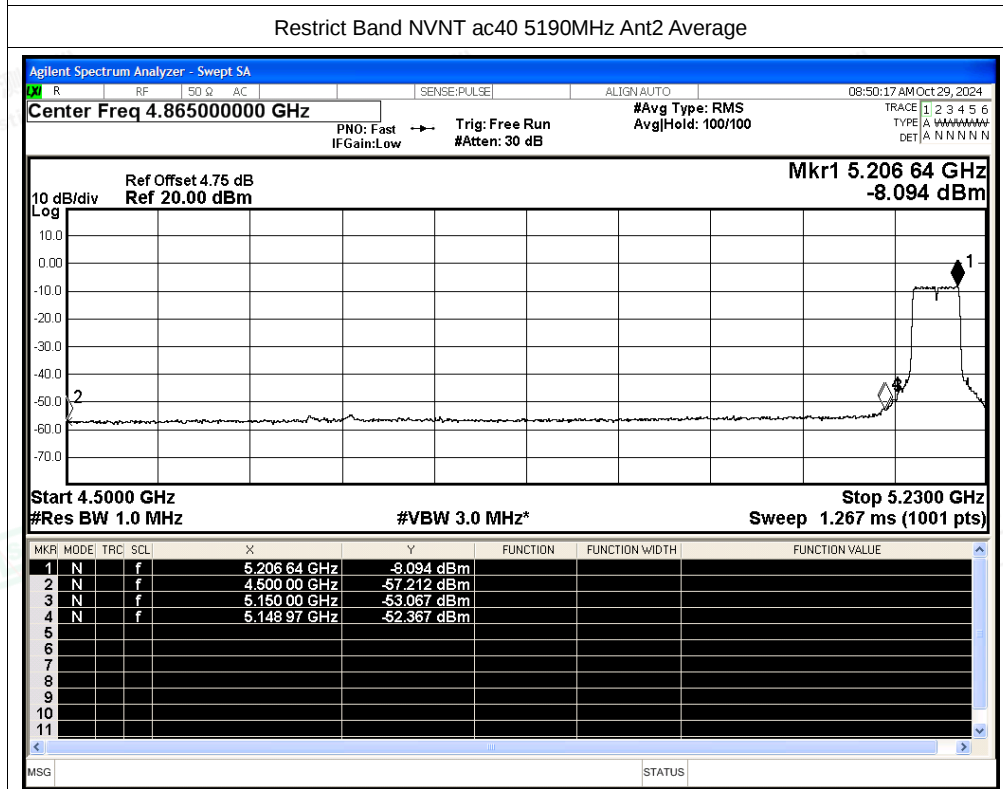
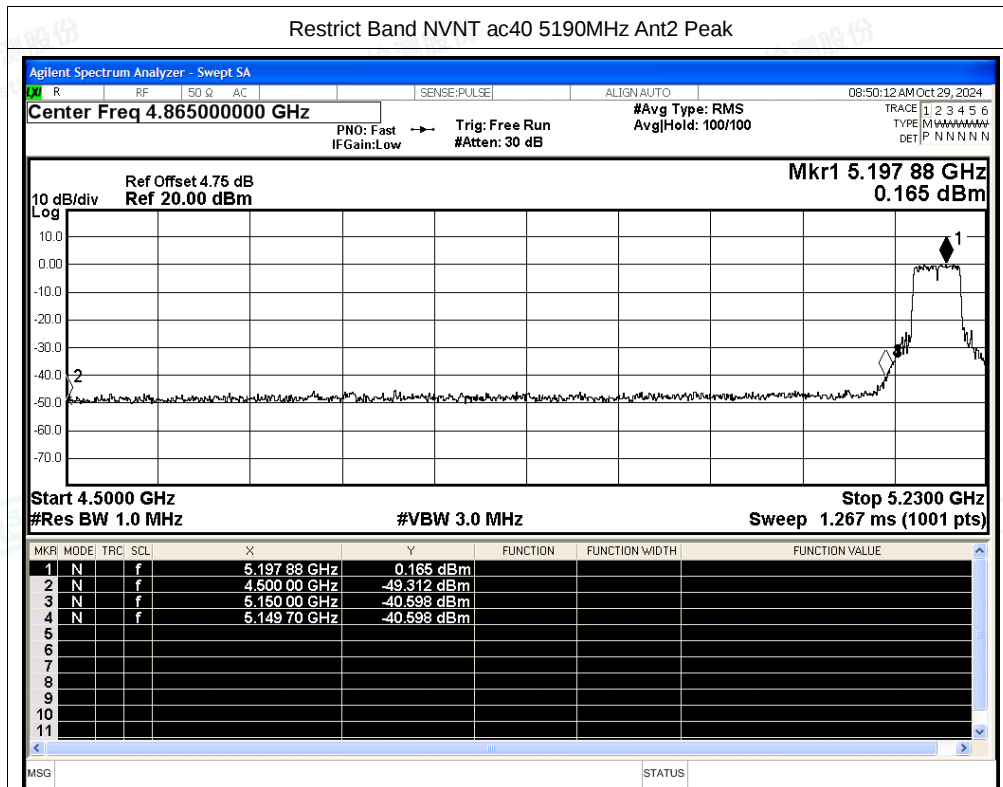


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

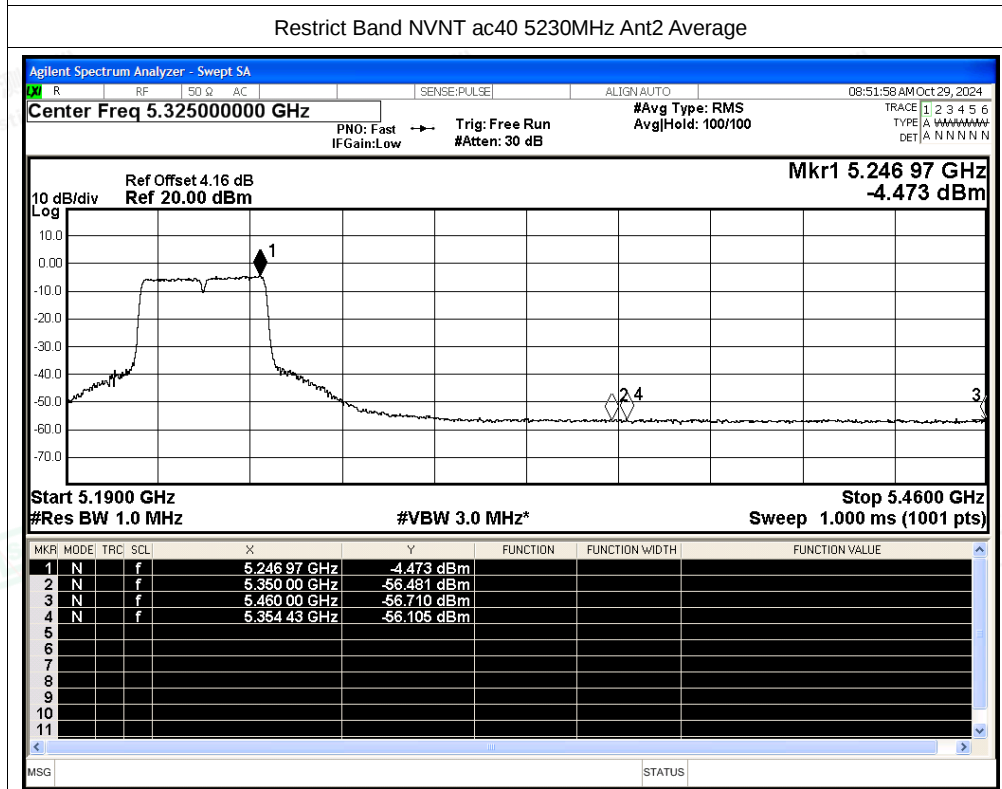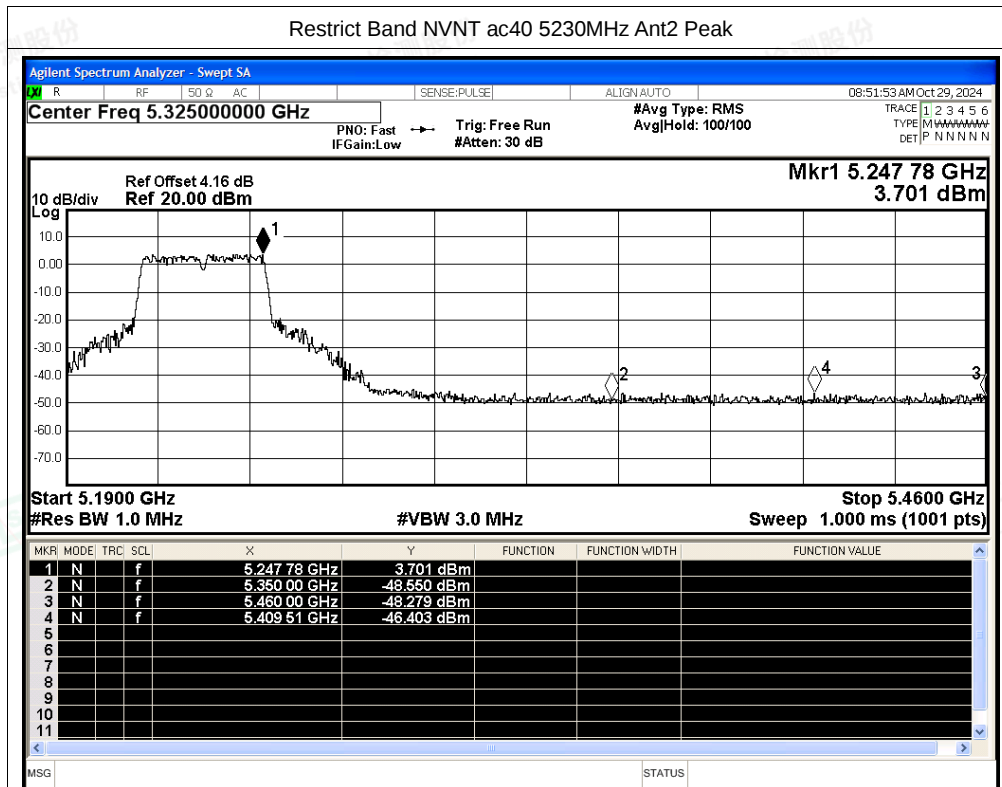

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity





Restrict Band NVNT ac80 5210MHz Ant2 Peak

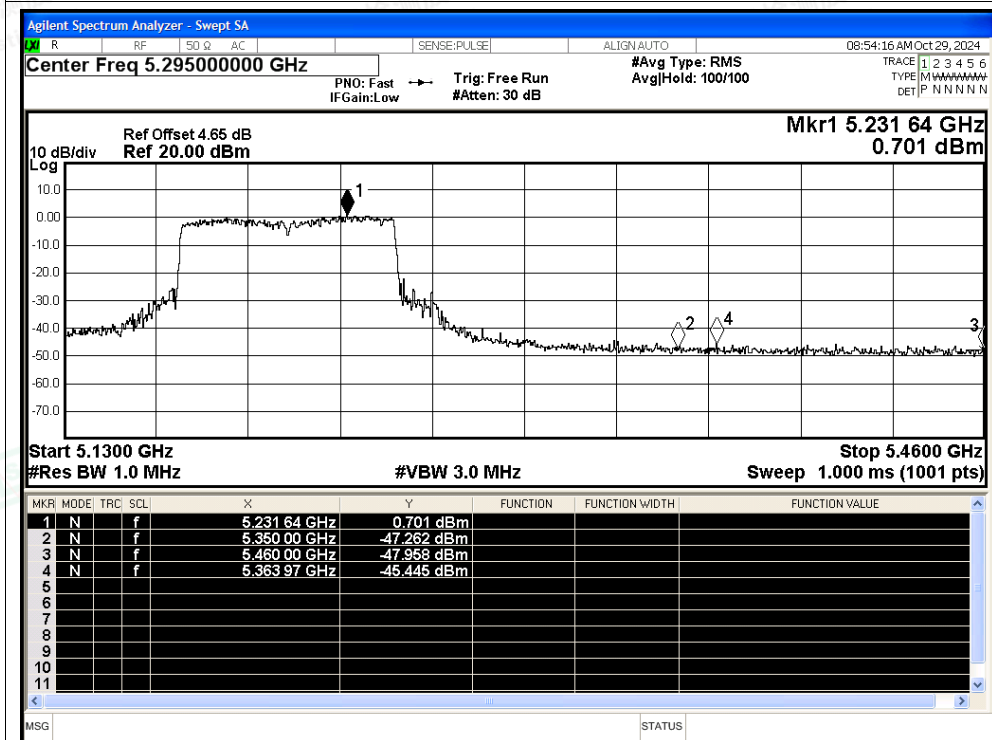

Restrict Band NVNT ac80 5210MHz Ant2 Average

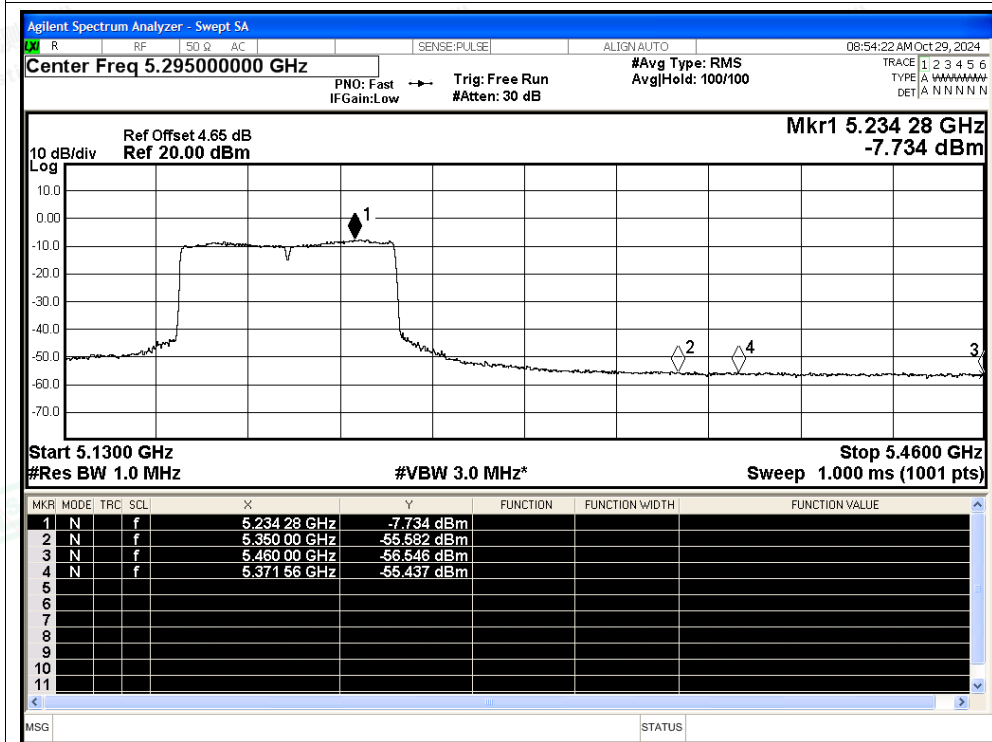

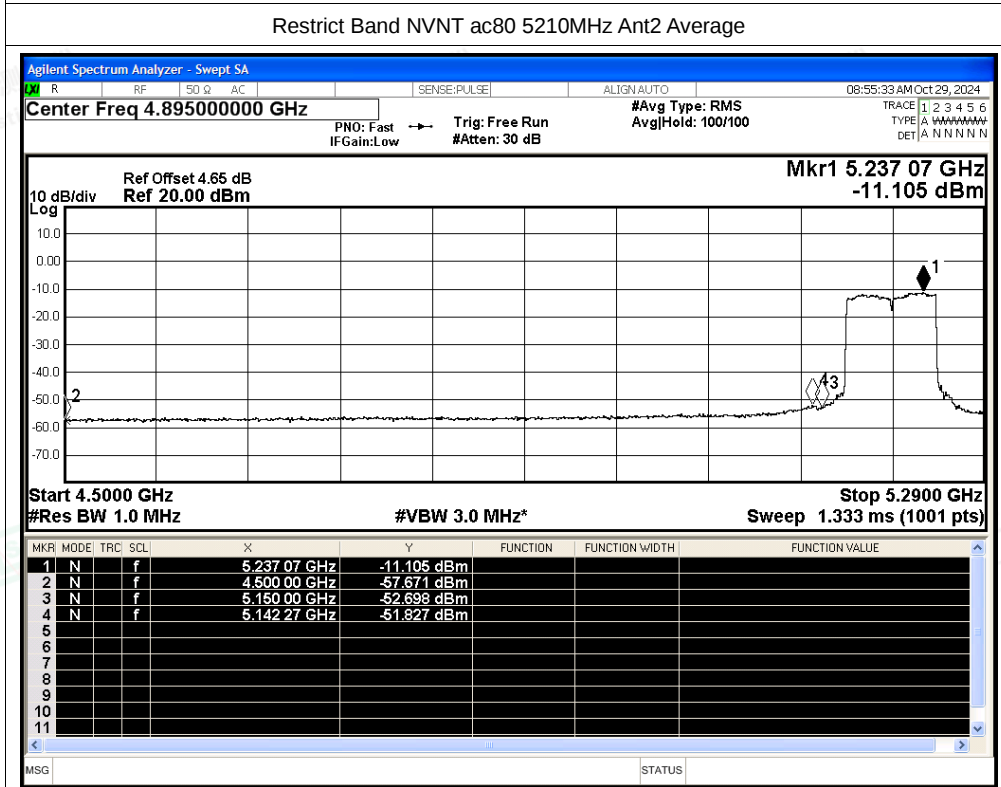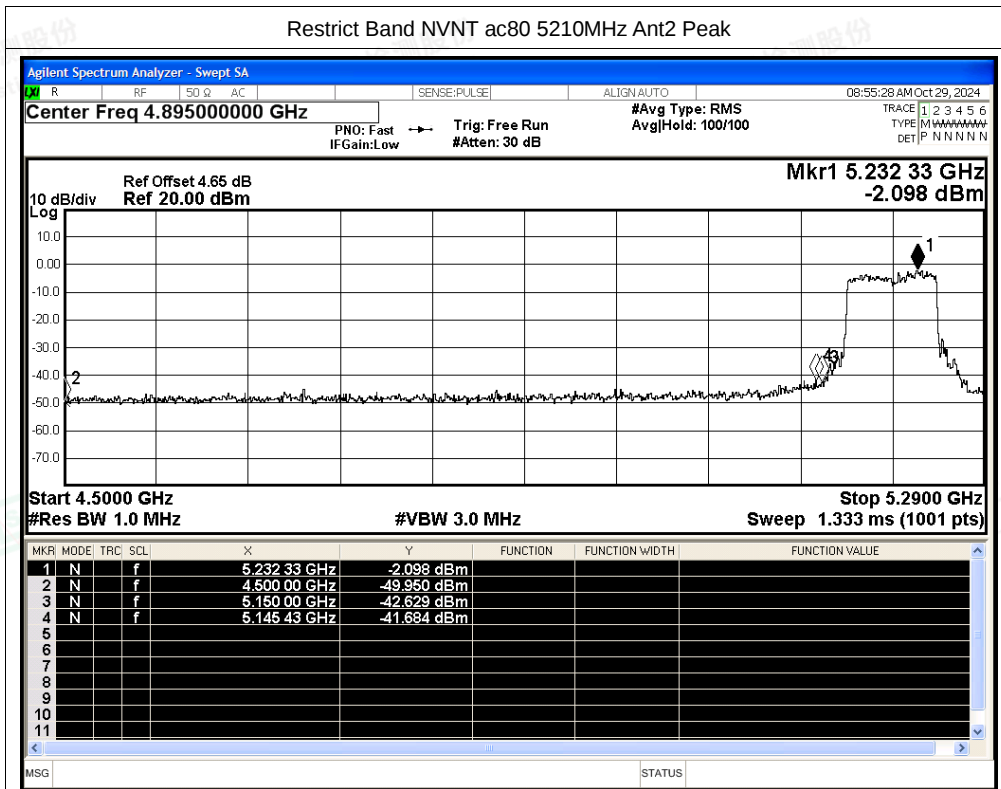

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Ant1 Power (dBm)	Ant2 Power (dBm)	SUM	Gain (dBi)	Total E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5180	-48.62	-49.34	-45.95	5.35	54.65	Peak	68.2	Pass
NVNT	n20	5180	-57.11	-57.48	-54.28	5.35	46.33	Average	54	Pass
NVNT	n20	5180	-37.89	-43.71	-36.88	5.35	63.73	Peak	68.2	Pass
NVNT	n20	5180	-51.89	-53.54	-49.63	5.35	50.98	Average	54	Pass
NVNT	n20	5180	-41.15	-43.58	-39.19	5.35	61.42	Peak	68.2	Pass
NVNT	n20	5180	-50.96	-53.49	-49.03	5.35	51.57	Average	54	Pass
NVNT	n20	5240	-48.09	-48.66	-45.36	5.35	55.25	Peak	68.2	Pass
NVNT	n20	5240	-56.44	-56.73	-53.57	5.35	47.04	Average	54	Pass
NVNT	n20	5240	-46.02	-46.14	-43.07	5.35	57.54	Peak	68.2	Pass
NVNT	n20	5240	-55.98	-56	-52.98	5.35	47.63	Average	54	Pass
NVNT	n20	5240	-49.93	-49.52	-46.71	5.35	53.90	Peak	68.2	Pass
NVNT	n20	5240	-56.98	-57.11	-54.03	5.35	46.57	Average	54	Pass
NVNT	n40	5190	-48.42	-47.82	-45.10	5.35	55.51	Peak	68.2	Pass
NVNT	n40	5190	-57.02	-56.92	-53.96	5.35	46.65	Average	54	Pass
NVNT	n40	5190	-41.67	-41.13	-38.38	5.35	62.23	Peak	68.2	Pass
NVNT	n40	5190	-52.33	-53.78	-49.98	5.35	50.62	Average	54	Pass
NVNT	n40	5190	-44.2	-41.13	-39.39	5.35	61.22	Peak	68.2	Pass
NVNT	n40	5190	-52.33	-54	-50.07	5.35	50.53	Average	54	Pass
NVNT	n40	5230	-48.38	-50.29	-46.22	5.35	54.39	Peak	68.2	Pass
NVNT	n40	5230	-56.45	-56.6	-53.51	5.35	47.09	Average	54	Pass
NVNT	n40	5230	-46.13	-45.83	-42.97	5.35	57.64	Peak	68.2	Pass
NVNT	n40	5230	-56.01	-56.1	-53.04	5.35	47.56	Average	54	Pass
NVNT	n40	5230	-49.86	-49.51	-46.67	5.35	53.94	Peak	68.2	Pass
NVNT	n40	5230	-57.27	-57.1	-54.17	5.35	46.43	Average	54	Pass
NVNT	ac20	5180	-49.37	-49.24	-46.29	5.35	54.31	Peak	68.2	Pass
NVNT	ac20	5180	-56.99	-57.89	-54.41	5.35	46.20	Average	54	Pass
NVNT	ac20	5180	-41.11	-40.96	-38.02	5.35	62.58	Peak	68.2	Pass
NVNT	ac20	5180	-52.66	-52.67	-49.65	5.35	50.95	Average	54	Pass
NVNT	ac20	5180	-39.37	-41.51	-37.30	5.35	63.31	Peak	68.2	Pass
NVNT	ac20	5180	-51.34	-52.22	-48.75	5.35	51.86	Average	54	Pass
NVNT	ac20	5240	-48.98	-47.62	-45.24	5.35	55.37	Peak	68.2	Pass
NVNT	ac20	5240	-56.57	-56.74	-53.64	5.35	46.96	Average	54	Pass
NVNT	ac20	5240	-46.21	-46.47	-43.33	5.35	57.28	Peak	68.2	Pass
NVNT	ac20	5240	-56.09	-55.9	-52.98	5.35	47.62	Average	54	Pass
NVNT	ac20	5240	-49.2	-49.69	-46.43	5.35	54.18	Peak	68.2	Pass
NVNT	ac20	5240	-57.04	-57.23	-54.12	5.35	46.48	Average	54	Pass
NVNT	ac40	5190	-47.8	-49.31	-45.48	5.35	55.13	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5190	-56.59	-57.21	-53.88	5.35	46.73	Average	54	Pass
NVNT	ac40	5190	-38.96	-40.6	-36.69	5.35	63.91	Peak	68.2	Pass
NVNT	ac40	5190	-52.28	-52.37	-49.31	5.35	51.29	Average	54	Pass
NVNT	ac40	5190	-41.89	-40.6	-38.19	5.35	62.42	Peak	68.2	Pass
NVNT	ac40	5190	-52.45	-53.07	-49.74	5.35	50.87	Average	54	Pass
NVNT	ac40	5230	-48.52	-48.55	-45.52	5.35	55.08	Peak	68.2	Pass
NVNT	ac40	5230	-56.8	-56.48	-53.63	5.35	46.98	Average	54	Pass
NVNT	ac40	5230	-45.89	-46.4	-43.13	5.35	57.48	Peak	68.2	Pass
NVNT	ac40	5230	-56.11	-56.11	-53.10	5.35	47.51	Average	54	Pass
NVNT	ac40	5230	-49.88	-48.28	-46.00	5.35	54.61	Peak	68.2	Pass
NVNT	ac40	5230	-57.2	-56.71	-53.94	5.35	46.67	Average	54	Pass
NVNT	ac80	5210	-47.55	-47.26	-44.39	5.35	56.22	Peak	68.2	Pass
NVNT	ac80	5210	-55.32	-55.58	-52.44	5.35	48.17	Average	54	Pass
NVNT	ac80	5210	-45.98	-45.45	-42.70	5.35	57.91	Peak	68.2	Pass
NVNT	ac80	5210	-55.32	-55.44	-52.37	5.35	48.24	Average	54	Pass
NVNT	ac80	5210	-47.09	-47.96	-44.49	5.35	56.11	Peak	68.2	Pass
NVNT	ac80	5210	-56.52	-56.55	-53.52	5.35	47.08	Average	54	Pass
NVNT	ac80	5210	-47.53	-49.95	-45.56	5.35	55.04	Peak	68.2	Pass
NVNT	ac80	5210	-57.46	-57.67	-54.55	5.35	46.05	Average	54	Pass
NVNT	ac80	5210	-43.97	-41.68	-39.67	5.35	60.94	Peak	68.2	Pass
NVNT	ac80	5210	-52.79	-51.83	-49.27	5.35	51.33	Average	54	Pass
NVNT	ac80	5210	-44.05	-42.63	-40.27	5.35	60.34	Peak	68.2	Pass
NVNT	ac80	5210	-52.78	-52.7	-49.73	5.35	50.88	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



D.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	a	5200	Ant1	5200	0	0	25	Pass
NVNT	a	5240	Ant1	5240	0	0	25	Pass
NVNT	n20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant1	5200	0	0	25	Pass
NVNT	n20	5240	Ant1	5240	0	0	25	Pass
NVNT	n40	5190	Ant1	5190	0	0	25	Pass
NVNT	n40	5230	Ant1	5230	0	0	25	Pass
NVNT	ac20	5180	Ant1	5179.98	-20000	-3.86	25	Pass
NVNT	ac20	5200	Ant1	5200	0	0	25	Pass
NVNT	ac20	5240	Ant1	5239.96	-40000	-7.63	25	Pass
NVNT	ac40	5190	Ant1	5189.96	-40000	-7.71	25	Pass
NVNT	ac40	5230	Ant1	5229.96	-40000	-7.65	25	Pass
NVNT	ac80	5210	Ant1	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant1

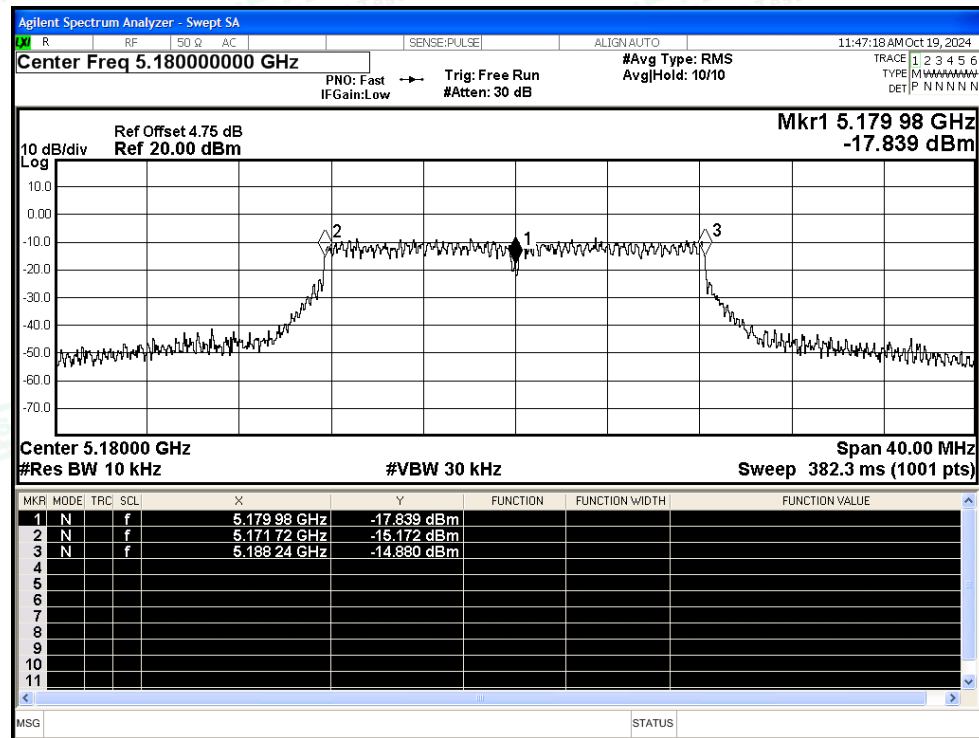

Freq. Stability NVNT a 5200MHz Ant1


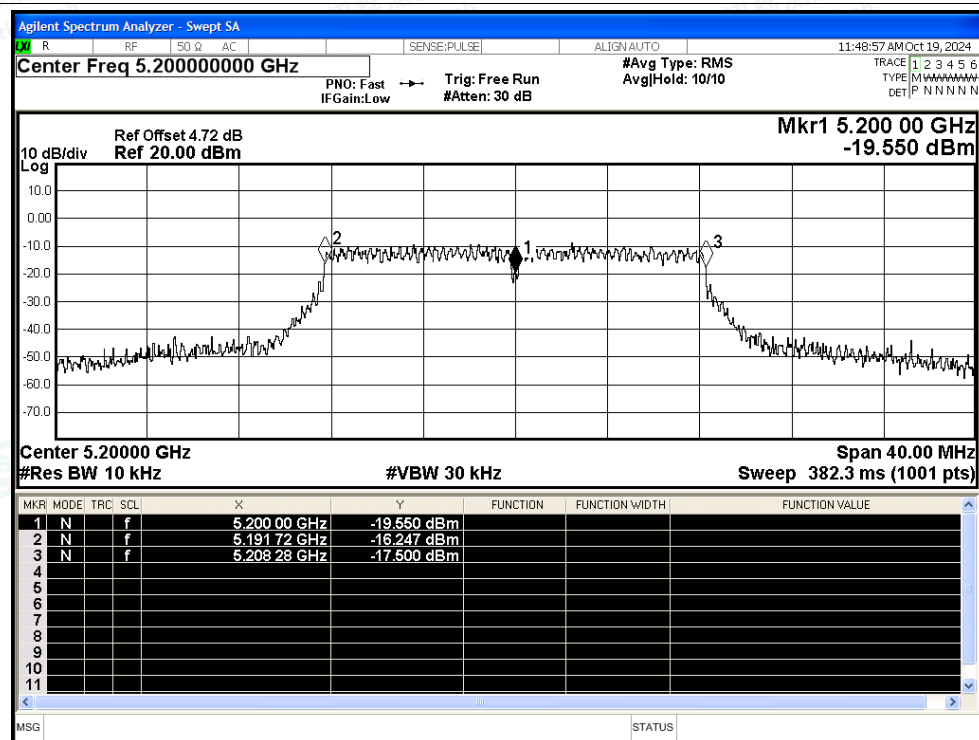




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

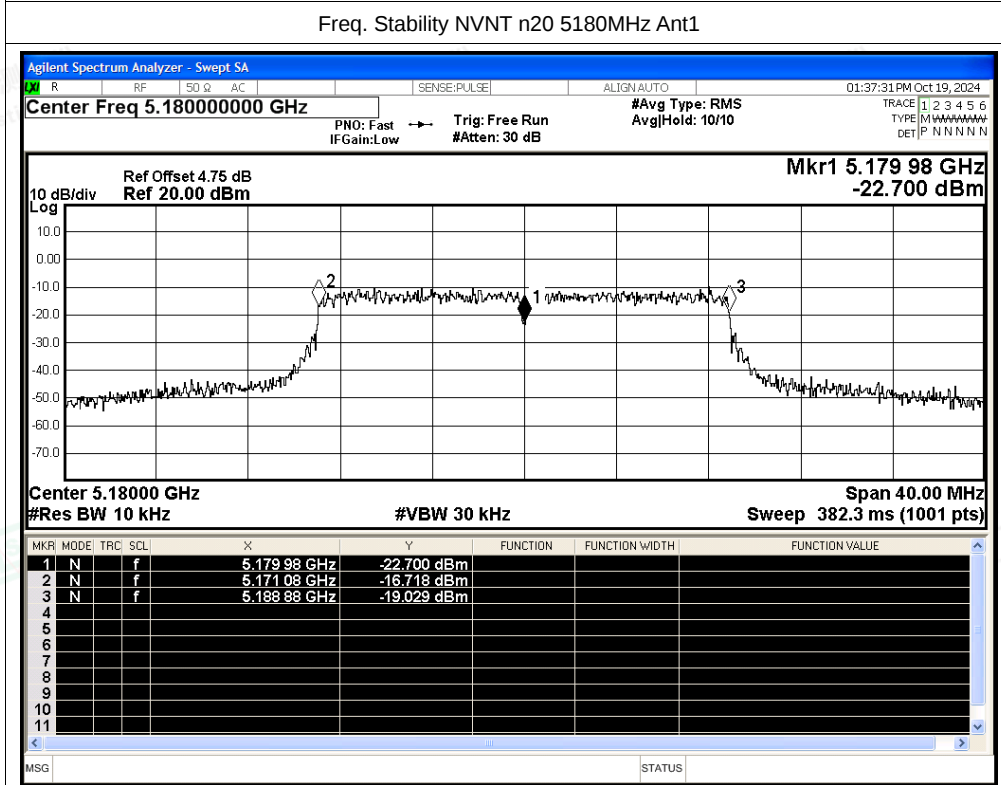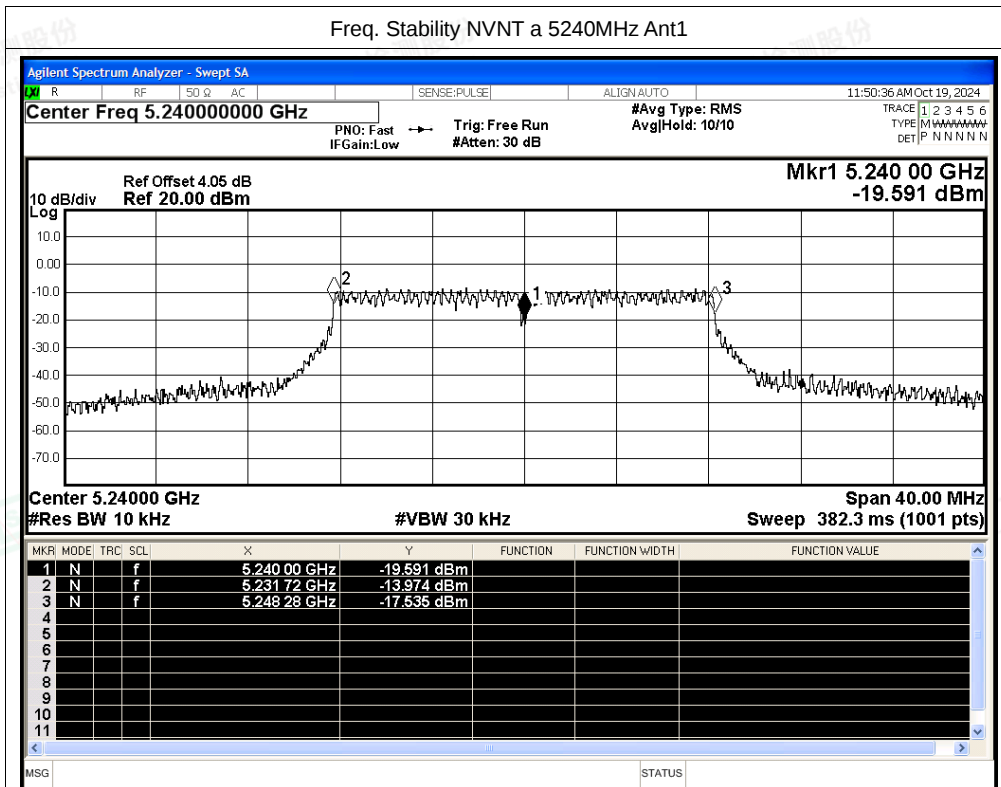

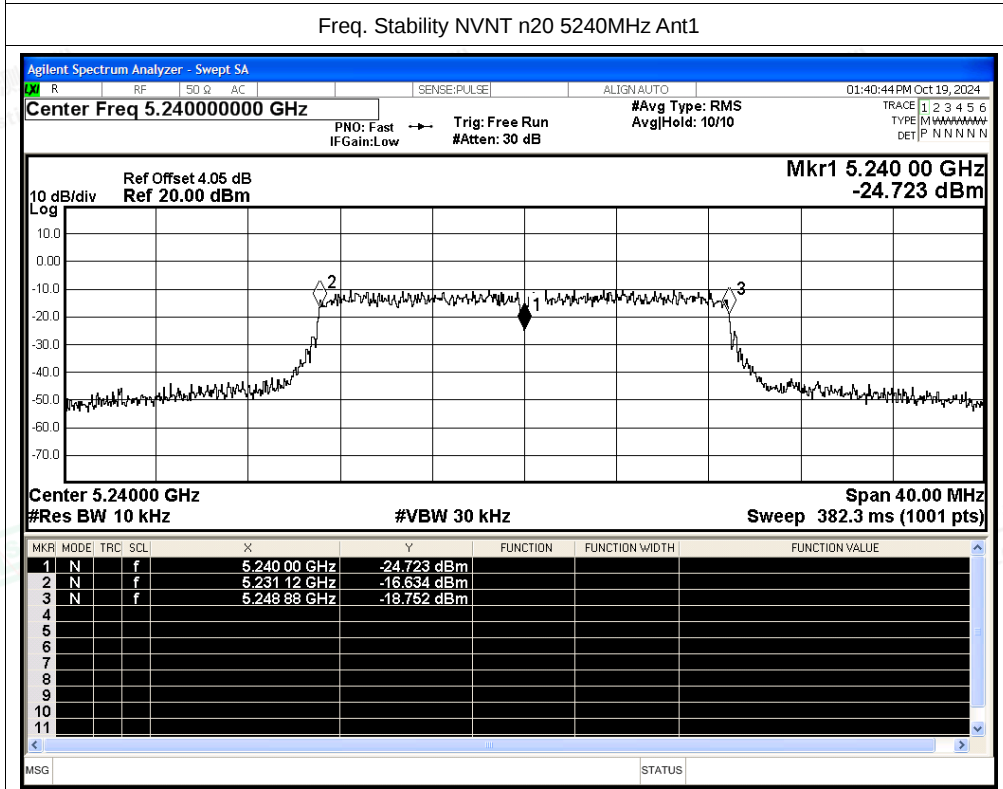
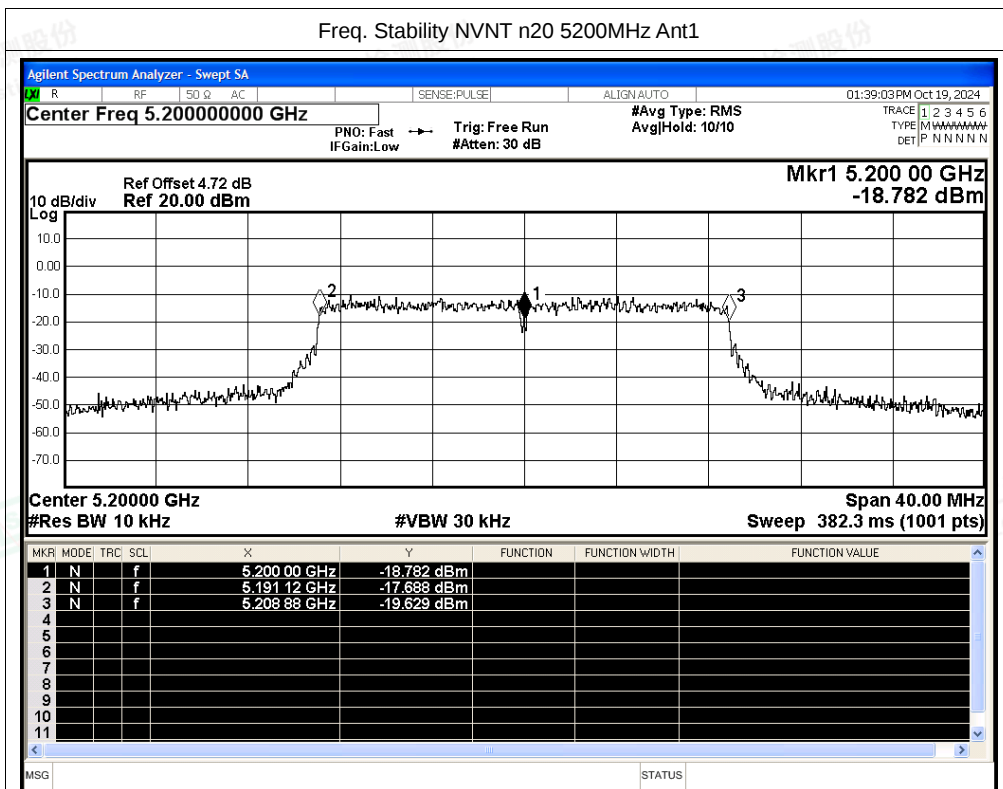


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

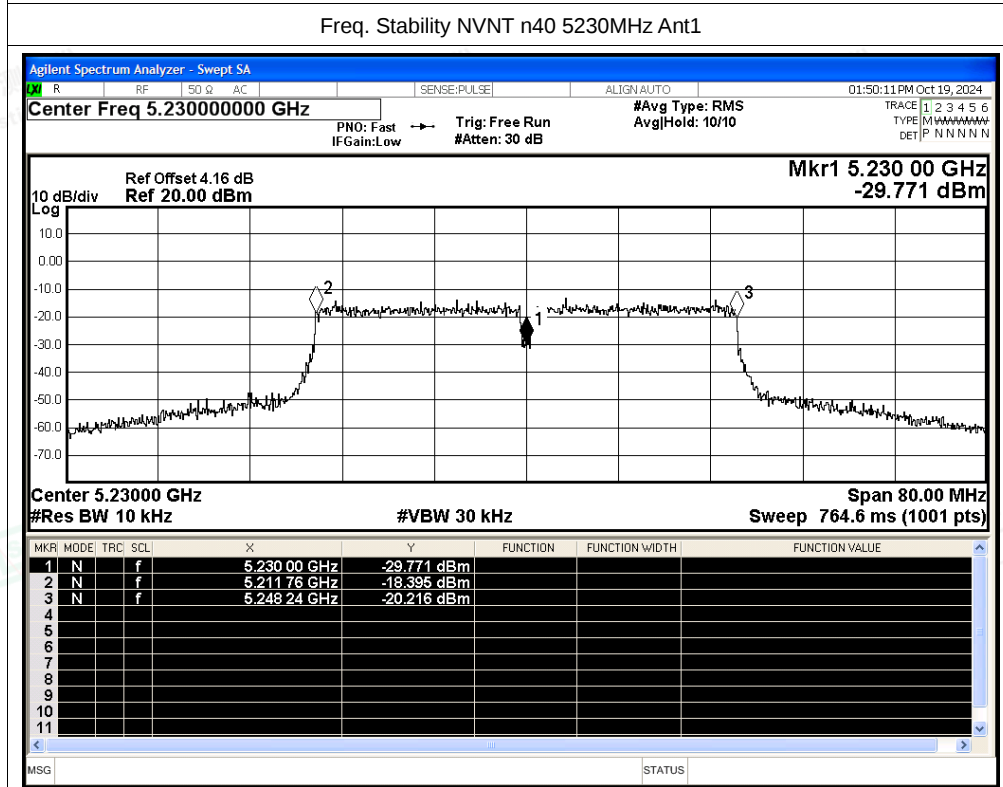
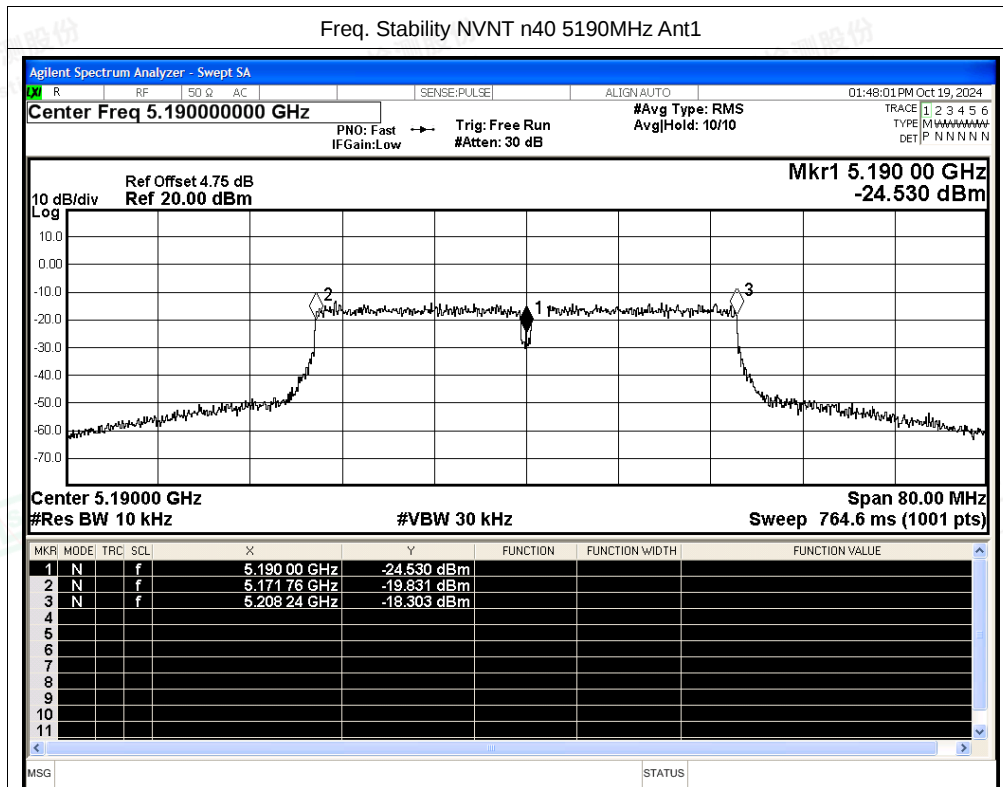


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

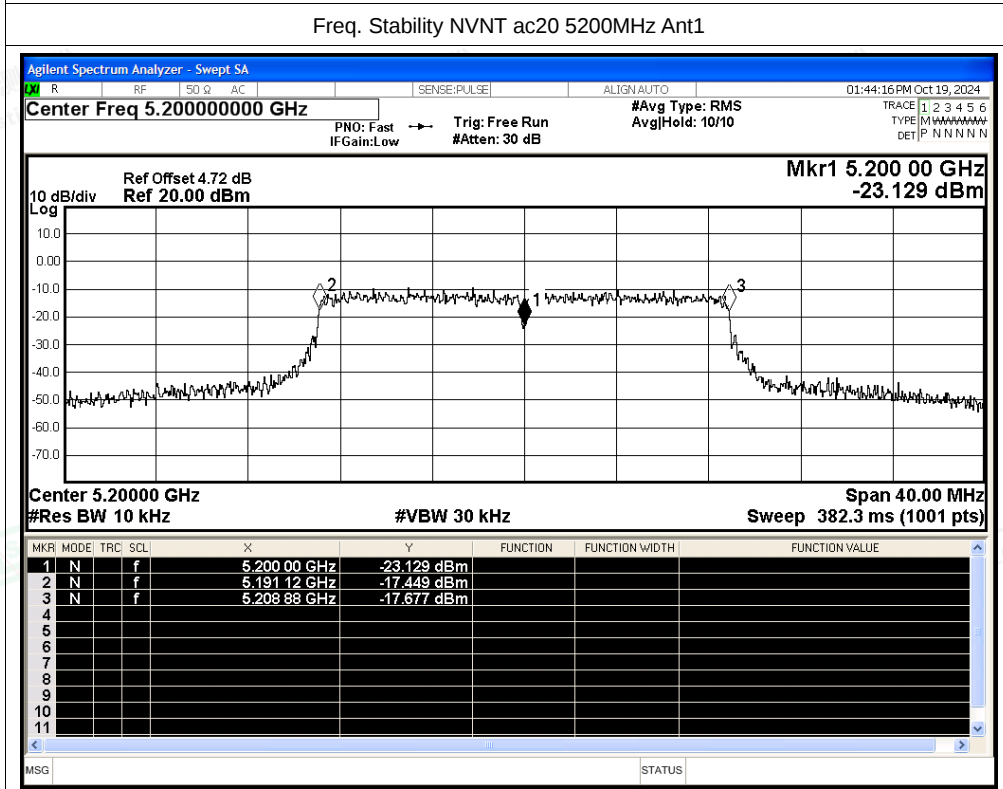
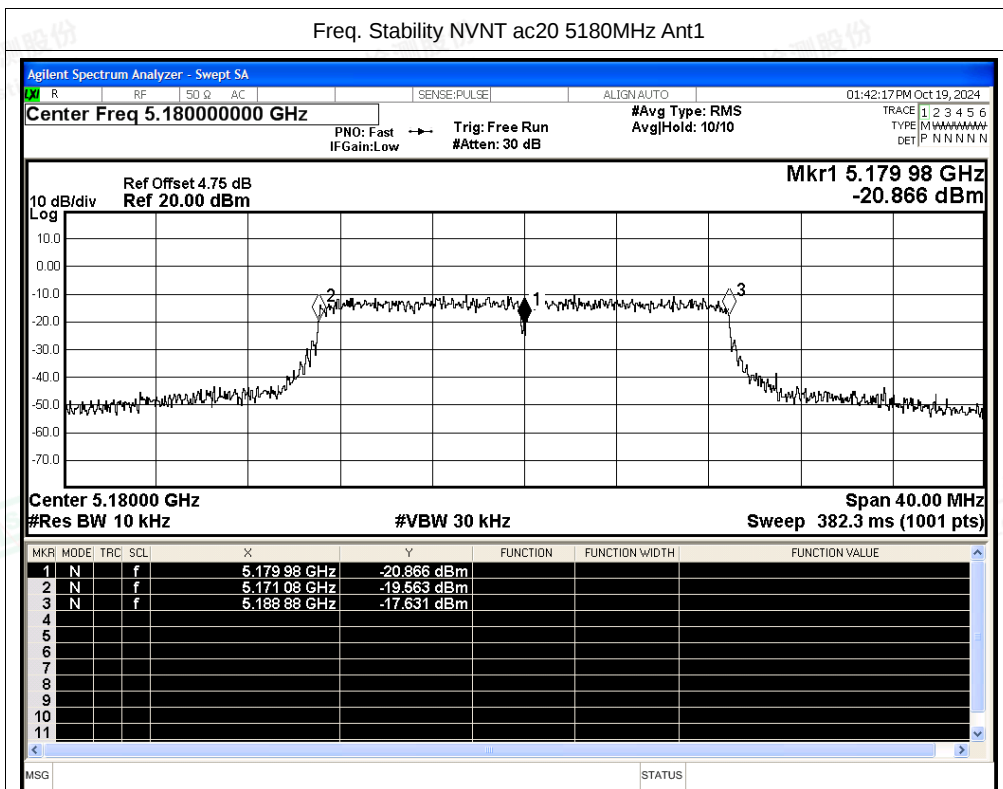




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

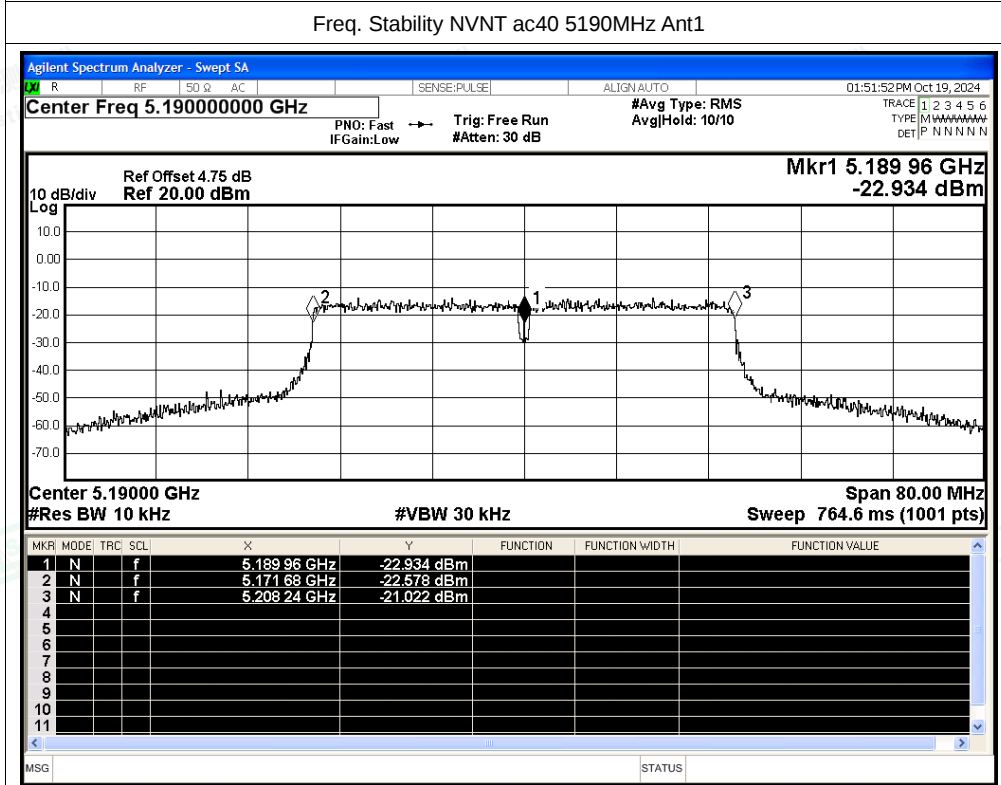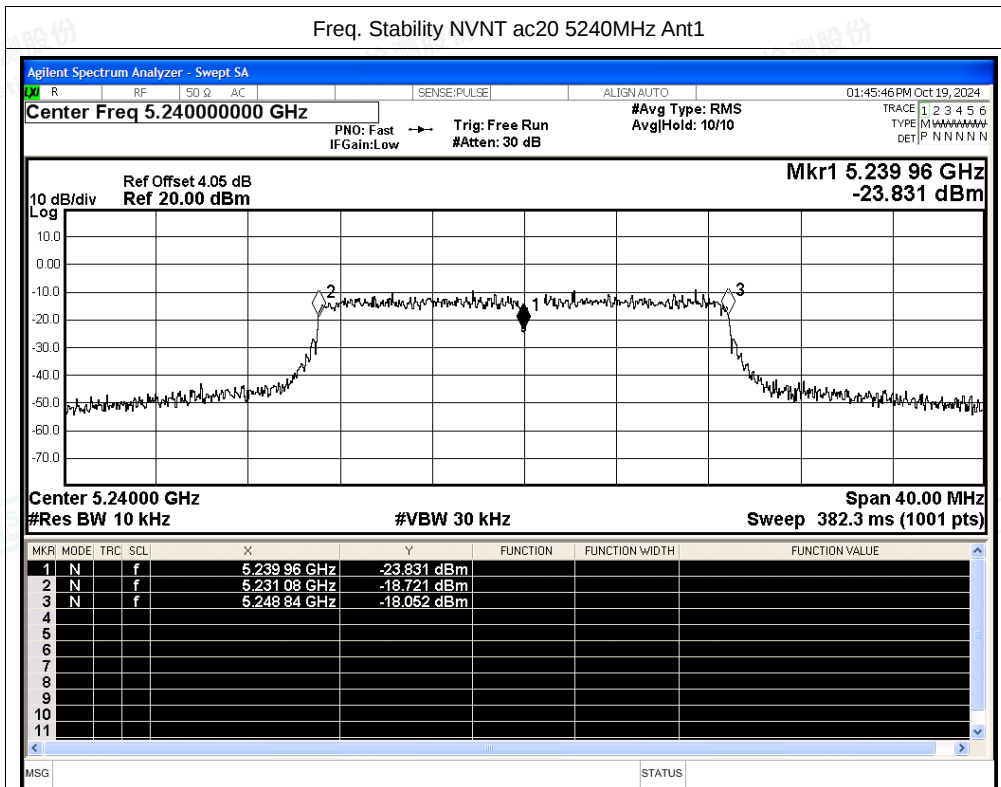

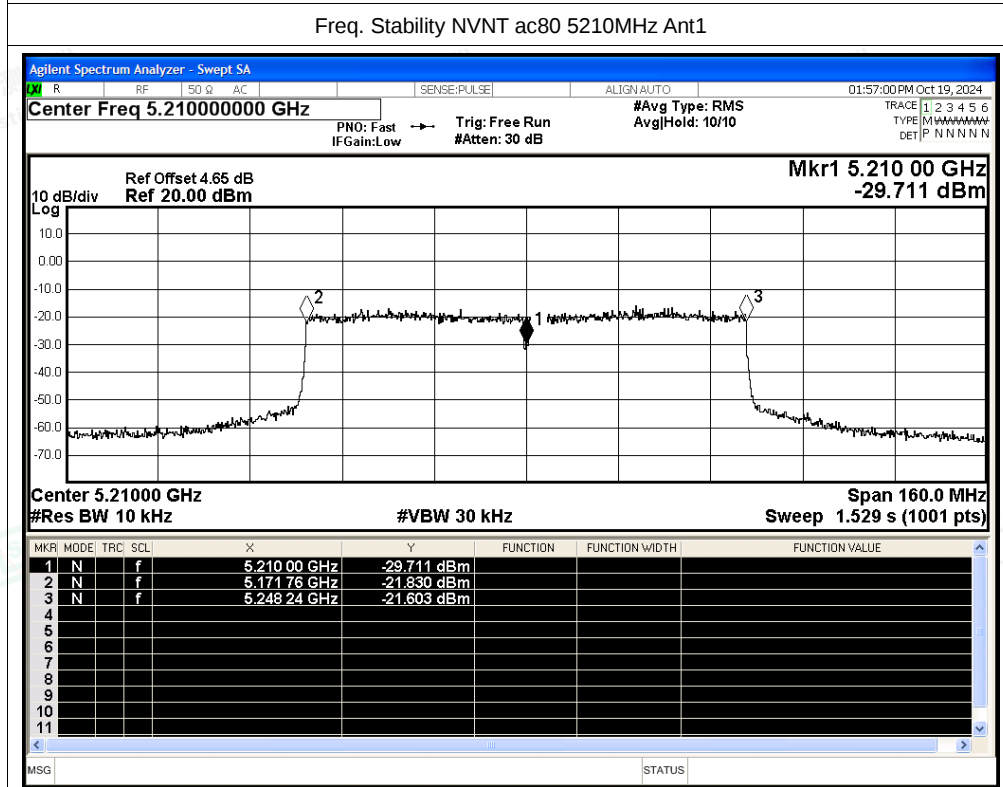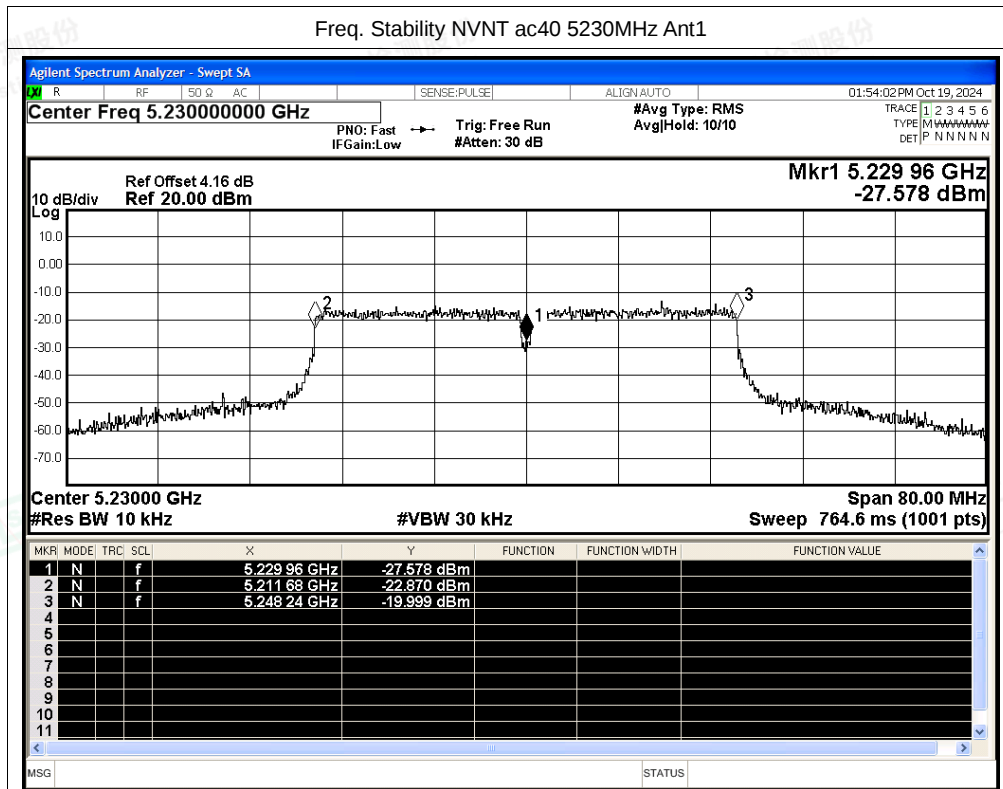


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

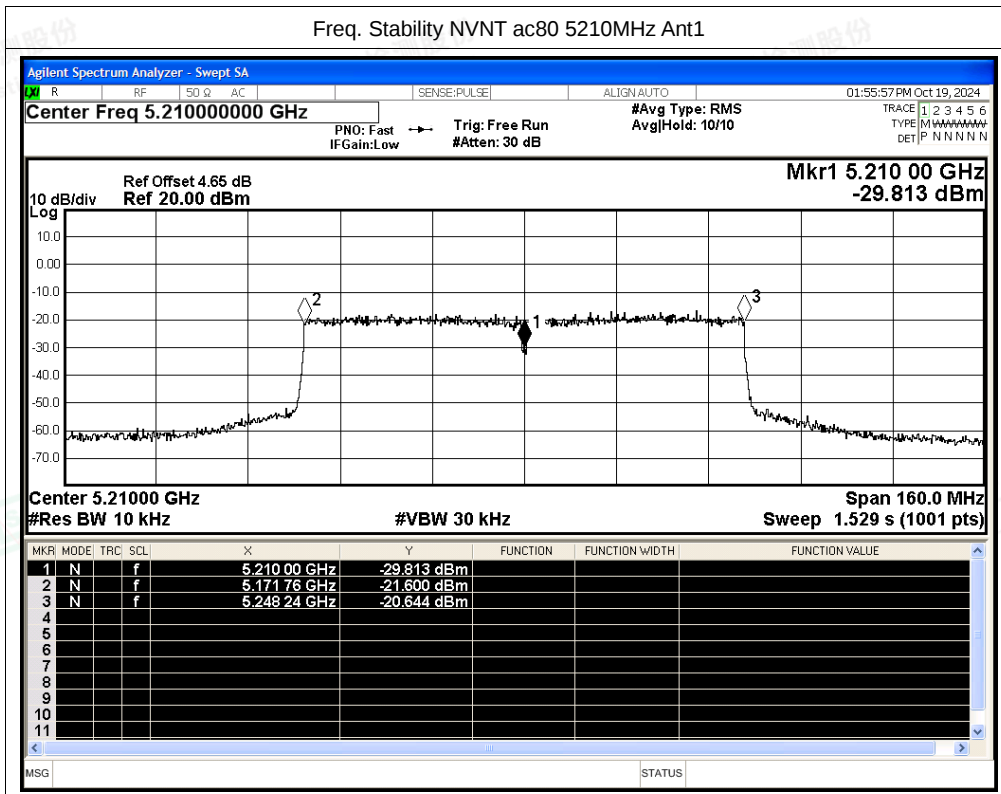




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5180	Ant2	5180	0	0	25	Pass
NVNT	a	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	a	5240	Ant2	5240	0	0	25	Pass
NVNT	n20	5180	Ant2	5179.98	-20000	-3.86	25	Pass
NVNT	n20	5200	Ant2	5199.98	-20000	-3.85	25	Pass
NVNT	n20	5240	Ant2	5240	0	0	25	Pass
NVNT	n40	5190	Ant2	5189.96	-40000	-7.71	25	Pass
NVNT	n40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac20	5180	Ant2	5180	0	0	25	Pass
NVNT	ac20	5200	Ant2	5200.02	20000	3.85	25	Pass
NVNT	ac20	5240	Ant2	5240	0	0	25	Pass
NVNT	ac40	5190	Ant2	5190	0	0	25	Pass
NVNT	ac40	5230	Ant2	5230	0	0	25	Pass
NVNT	ac80	5210	Ant2	5210	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5180MHz Ant2

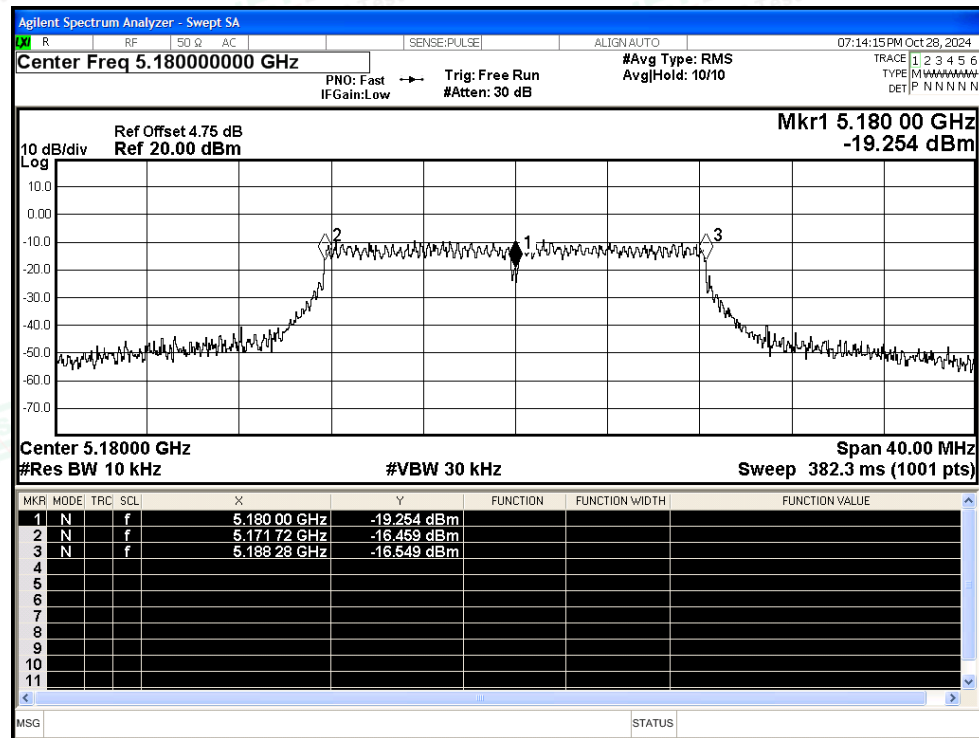

Freq. Stability NVNT a 5200MHz Ant2


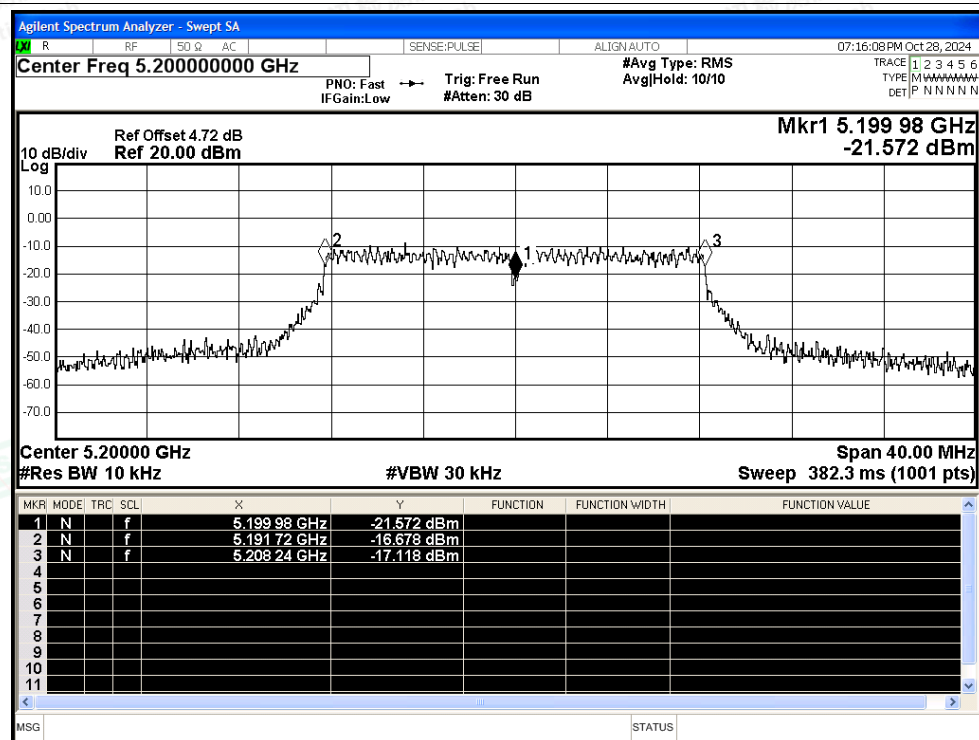




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

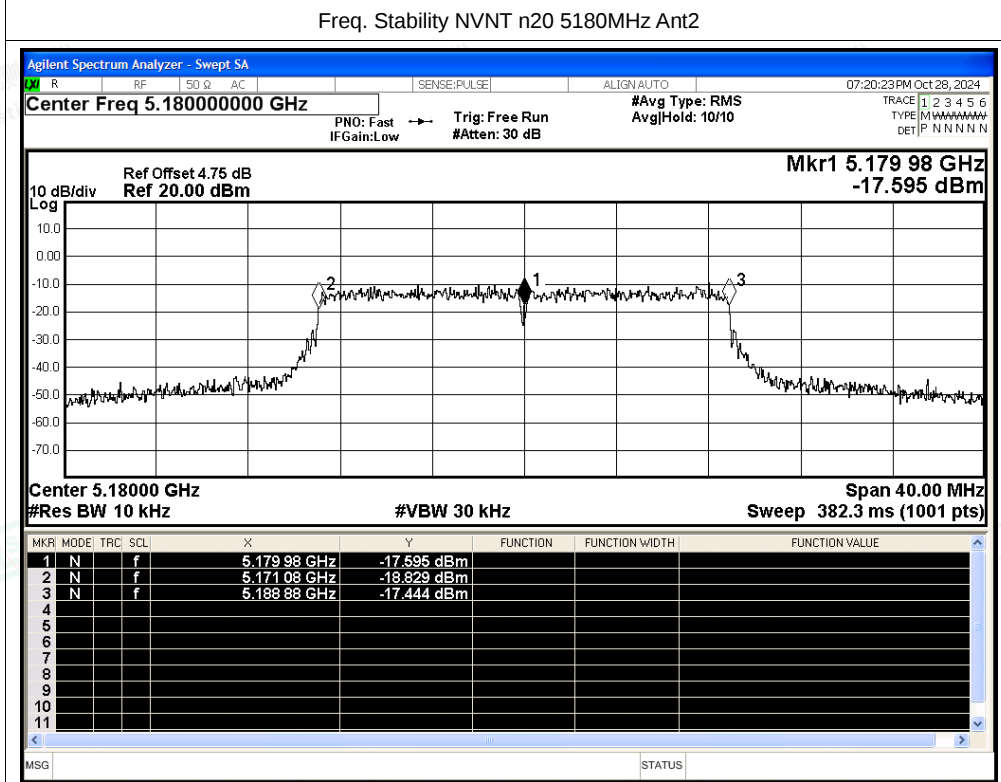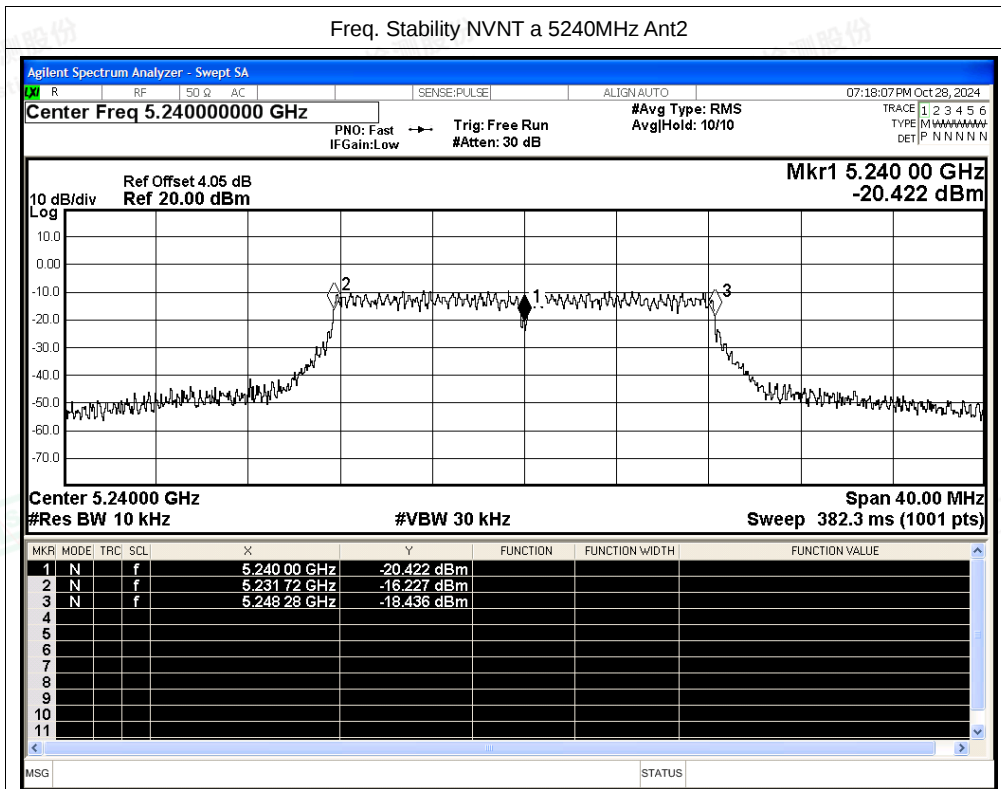

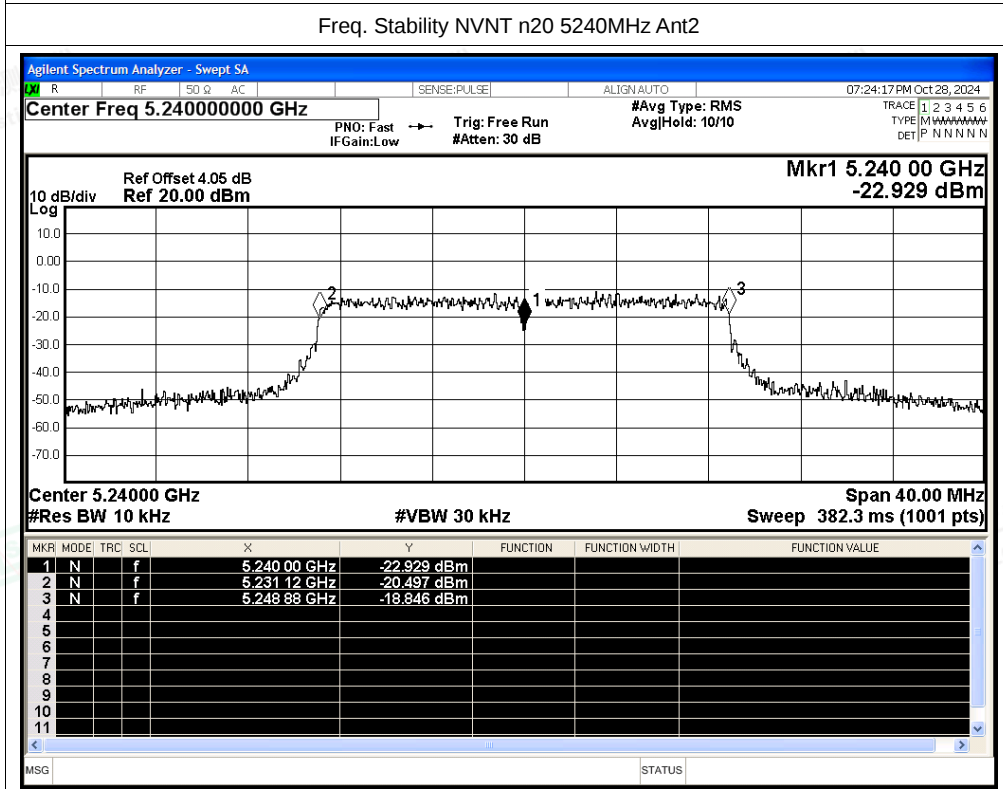
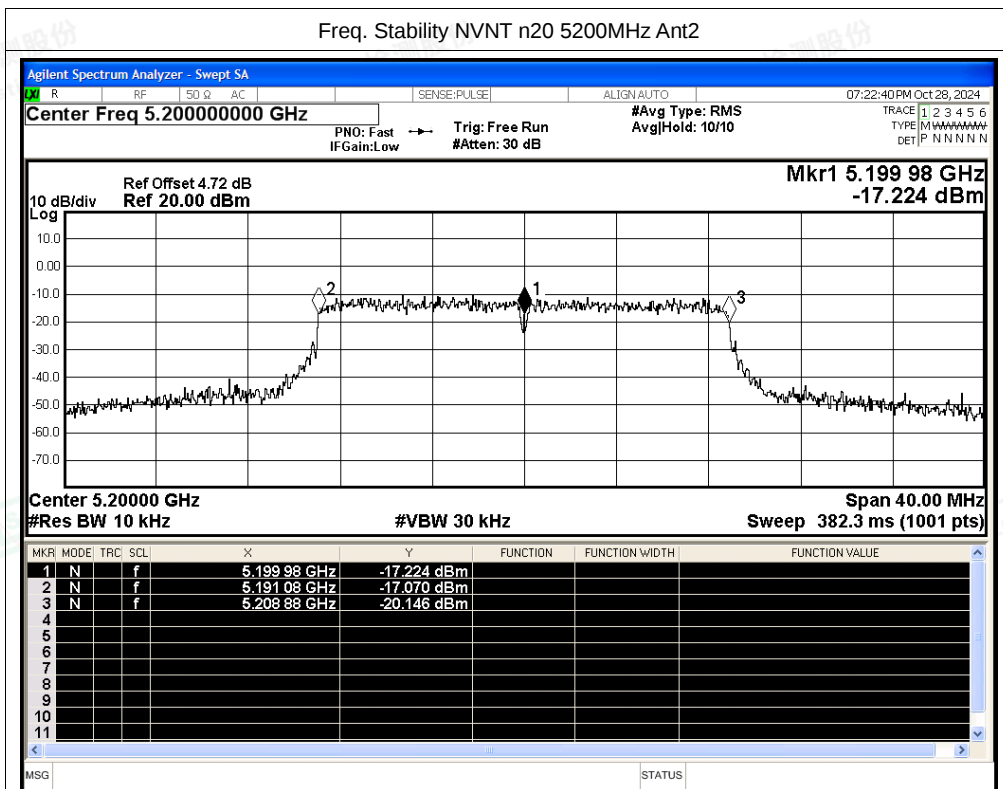


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

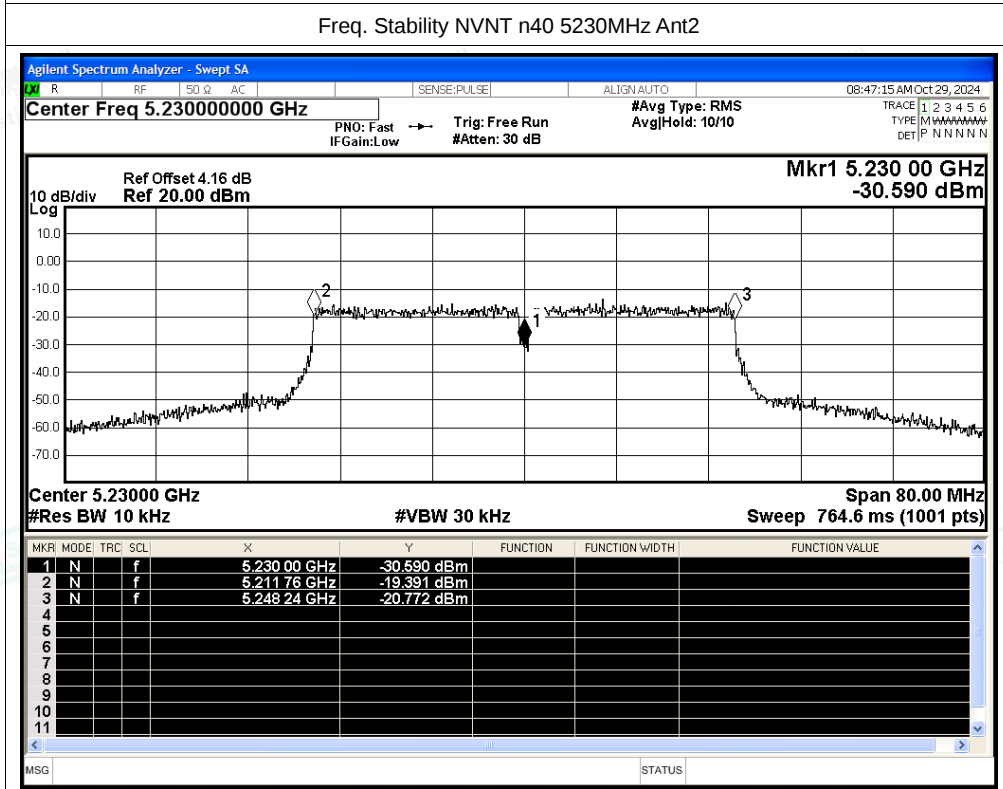
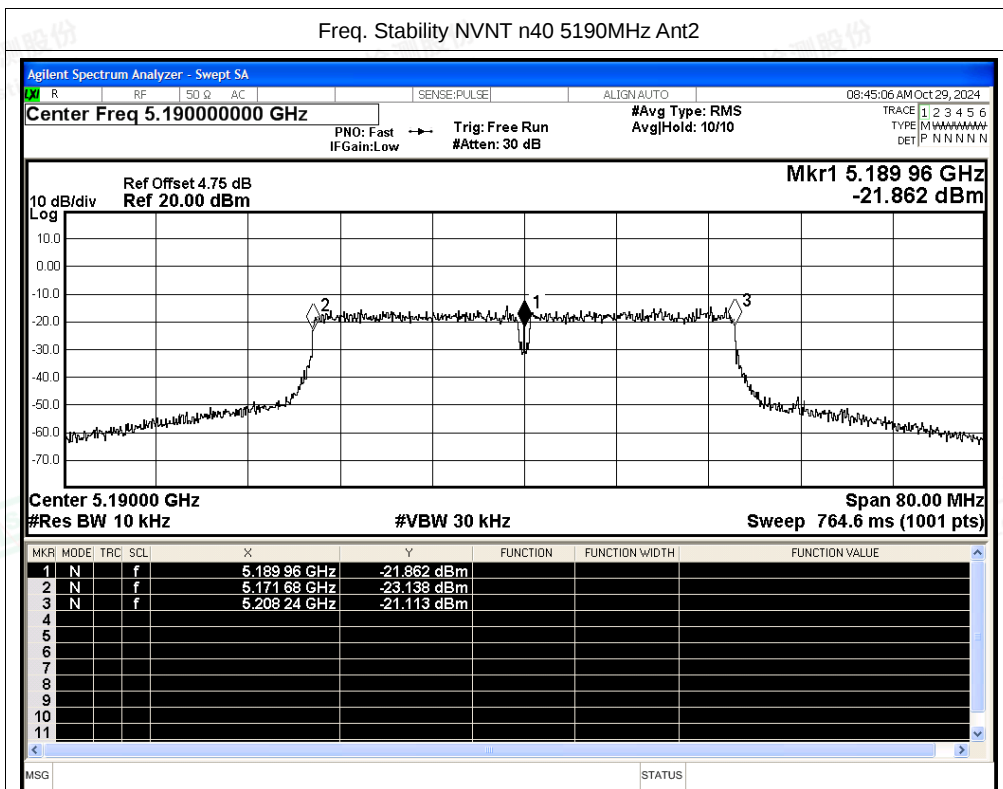


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

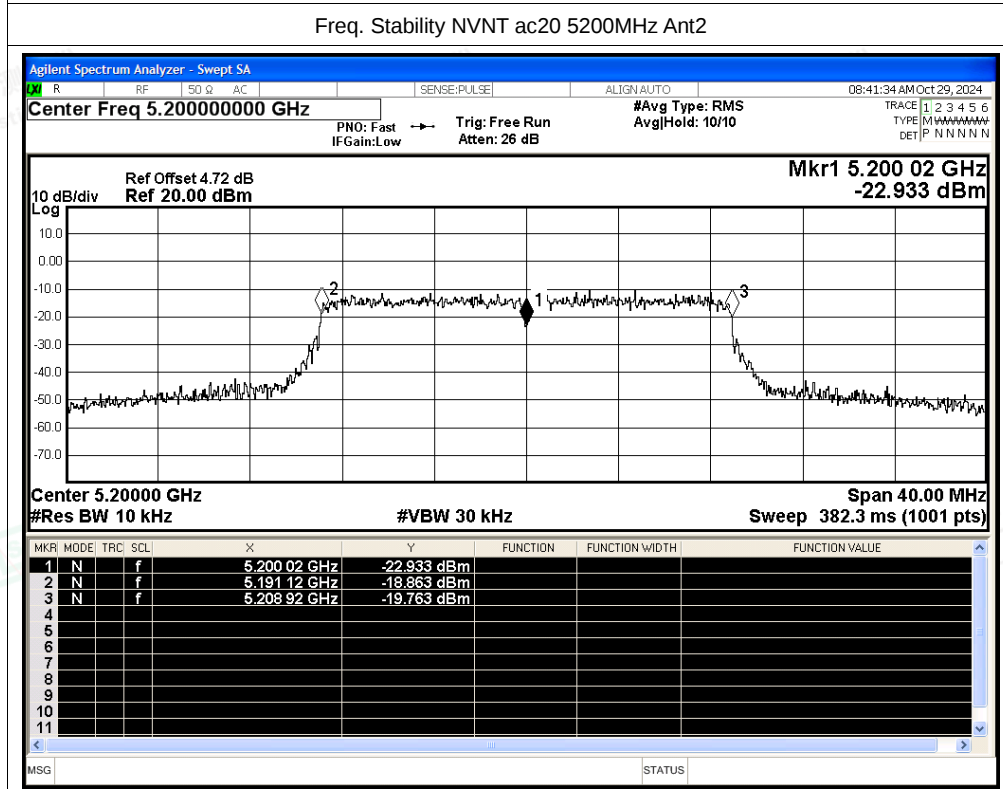
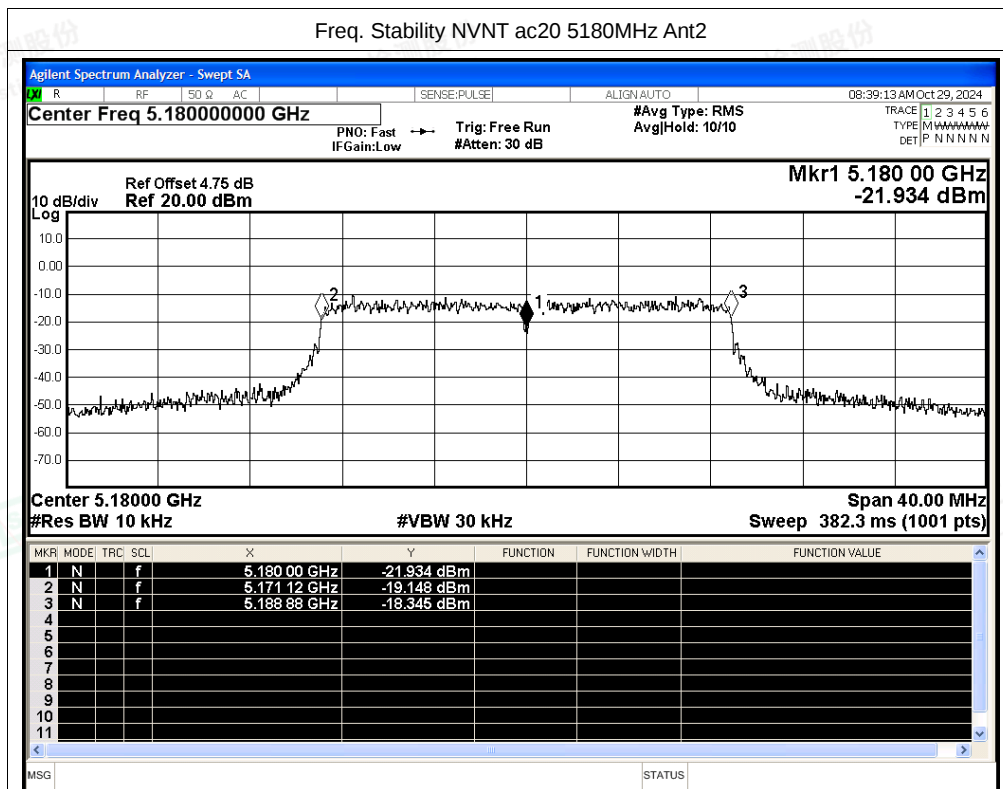


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

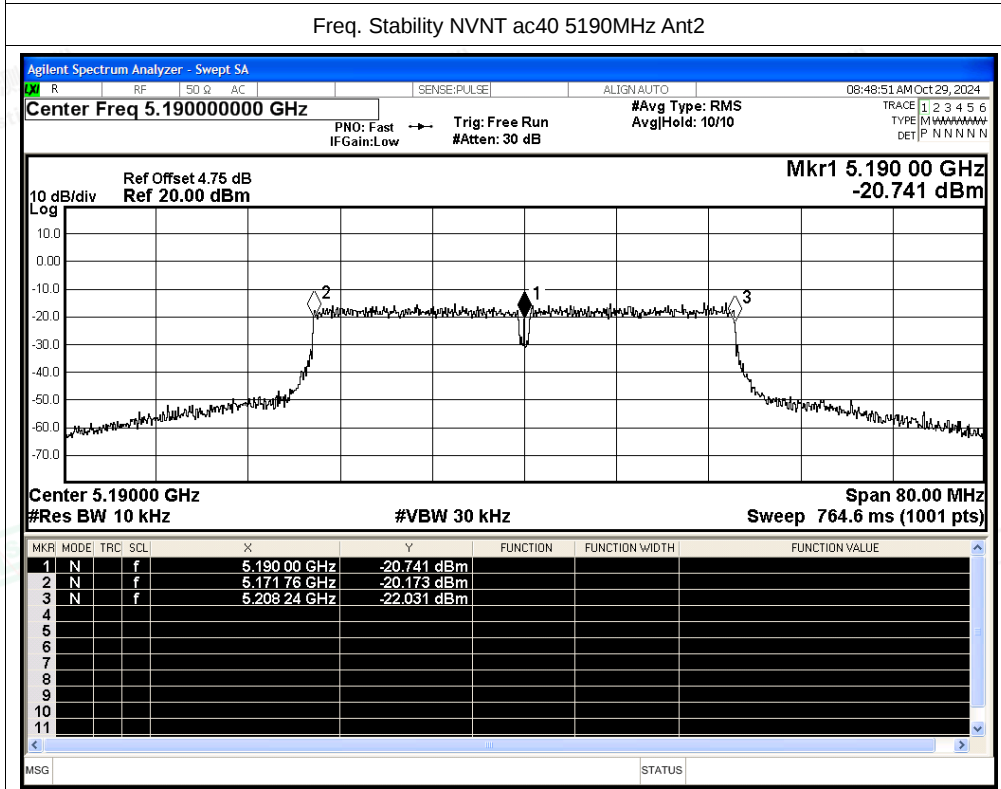
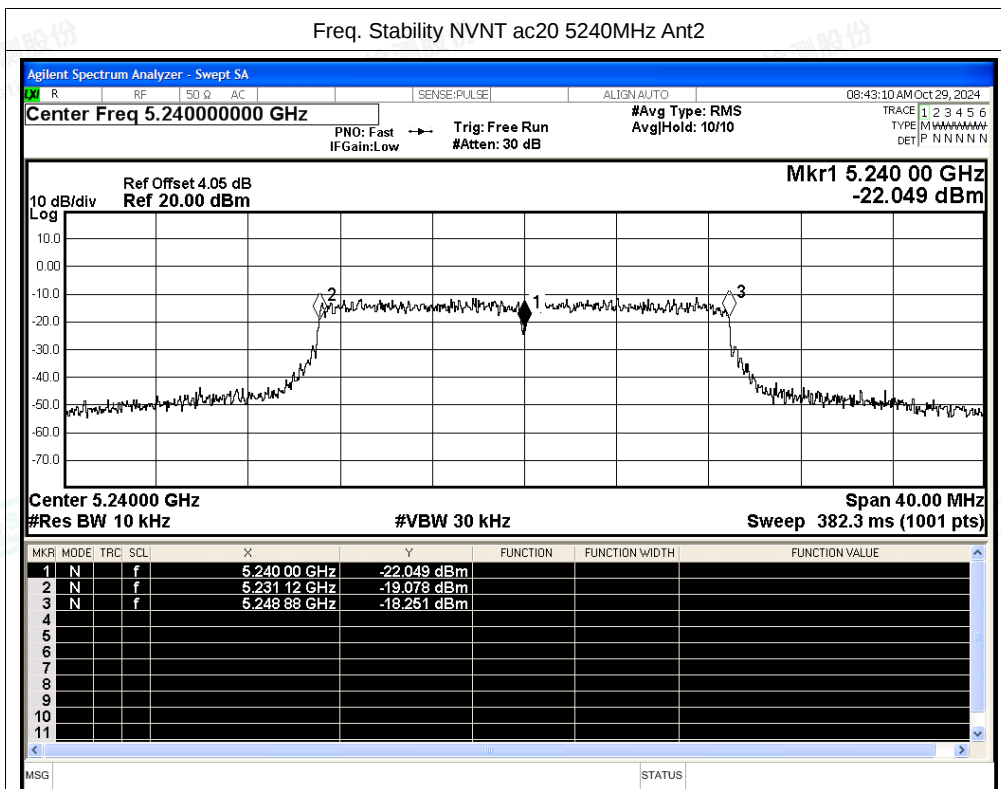



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

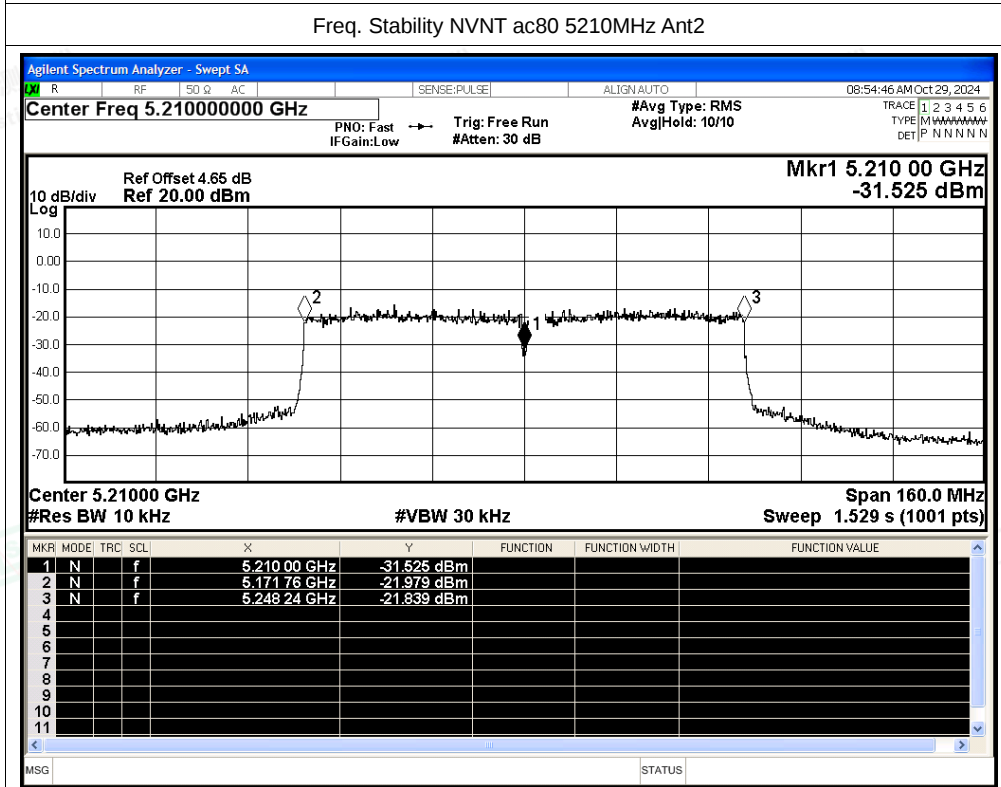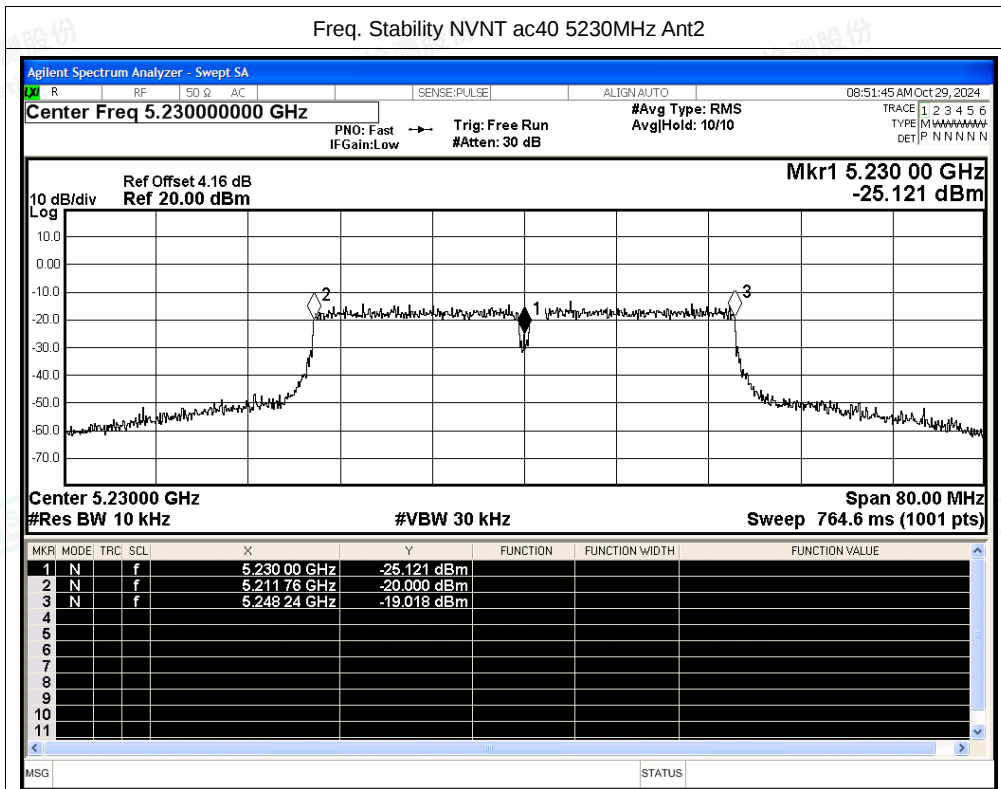

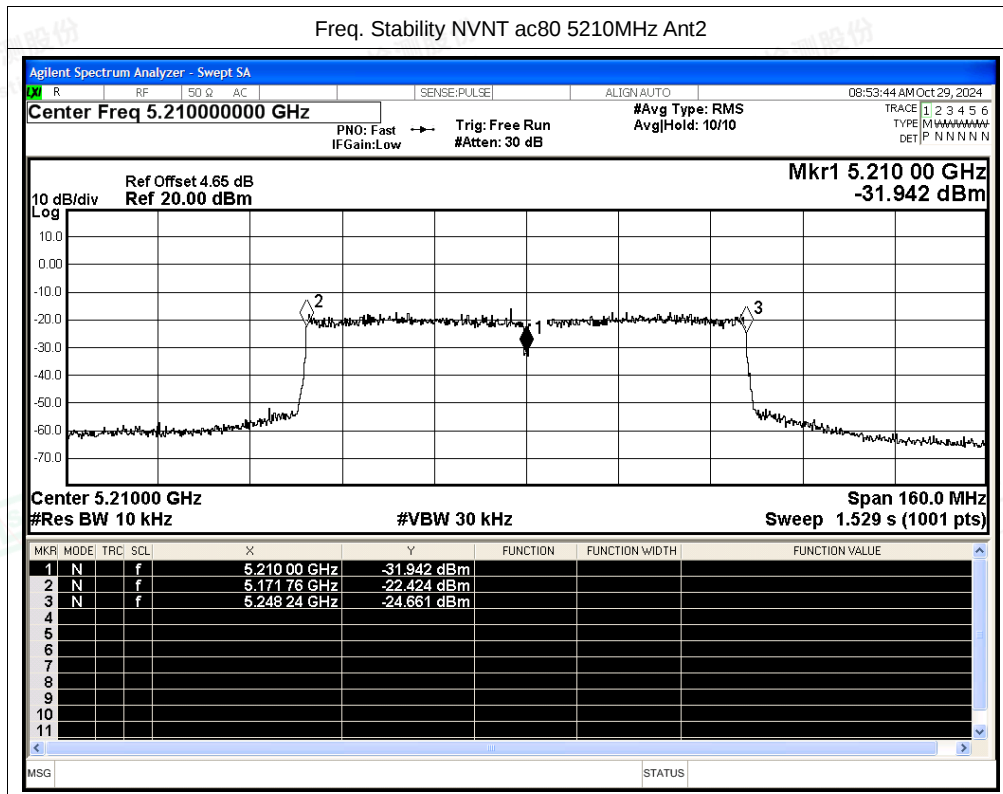



D.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant1	94.56	0.24	0.91
NVNT	a	5200	Ant1	94.65	0.24	0.91
NVNT	a	5240	Ant1	94.56	0.24	0.91
NVNT	n20	5180	Ant1	97.29	0.12	0.44
NVNT	n20	5200	Ant1	97.33	0.12	0.44
NVNT	n20	5240	Ant1	97.29	0.12	0.44
NVNT	n40	5190	Ant1	97.23	0.12	0.46
NVNT	n40	5230	Ant1	97.23	0.12	0.46
NVNT	ac20	5180	Ant1	97.3	0.12	0.44
NVNT	ac20	5200	Ant1	97.34	0.12	0.44
NVNT	ac20	5240	Ant1	97.34	0.12	0.44
NVNT	ac40	5190	Ant1	97.19	0.12	0.46
NVNT	ac40	5230	Ant1	97.19	0.12	0.46
NVNT	ac80	5210	Ant1	94.32	0.25	0.97






Test Graphs

Duty Cycle NVNT a 5180MHz Ant1

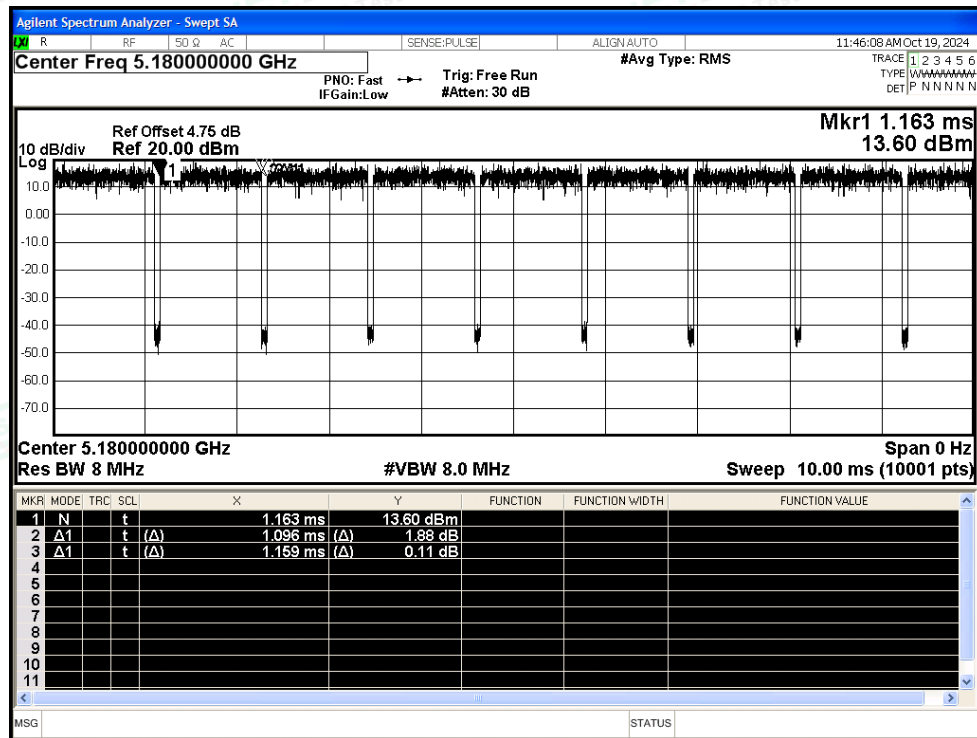

Duty Cycle NVNT a 5200MHz Ant1


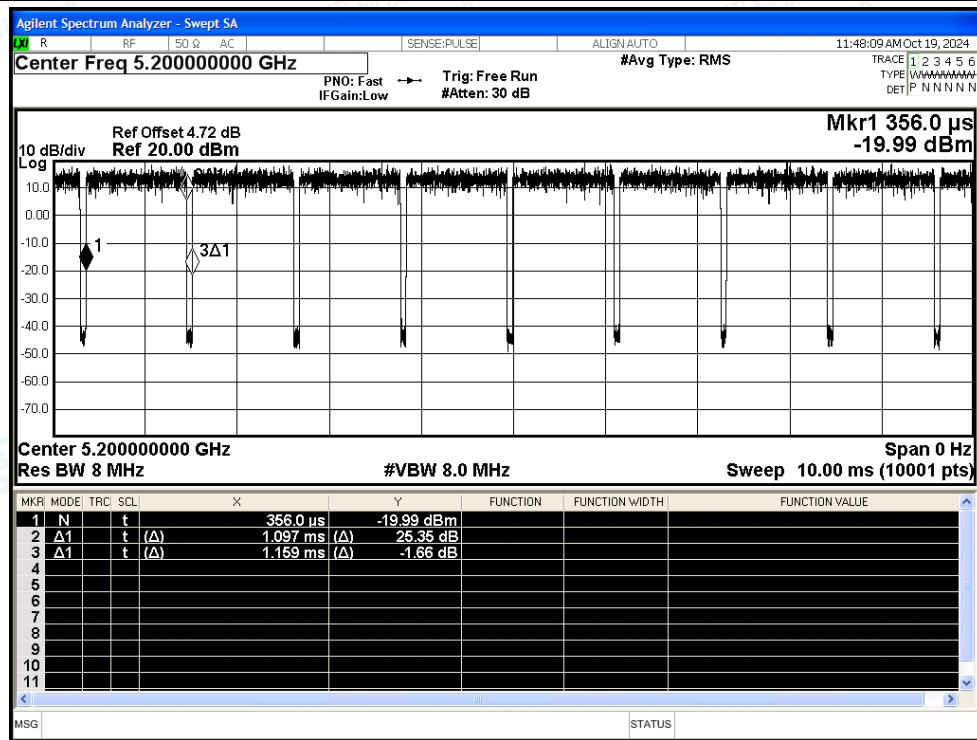




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

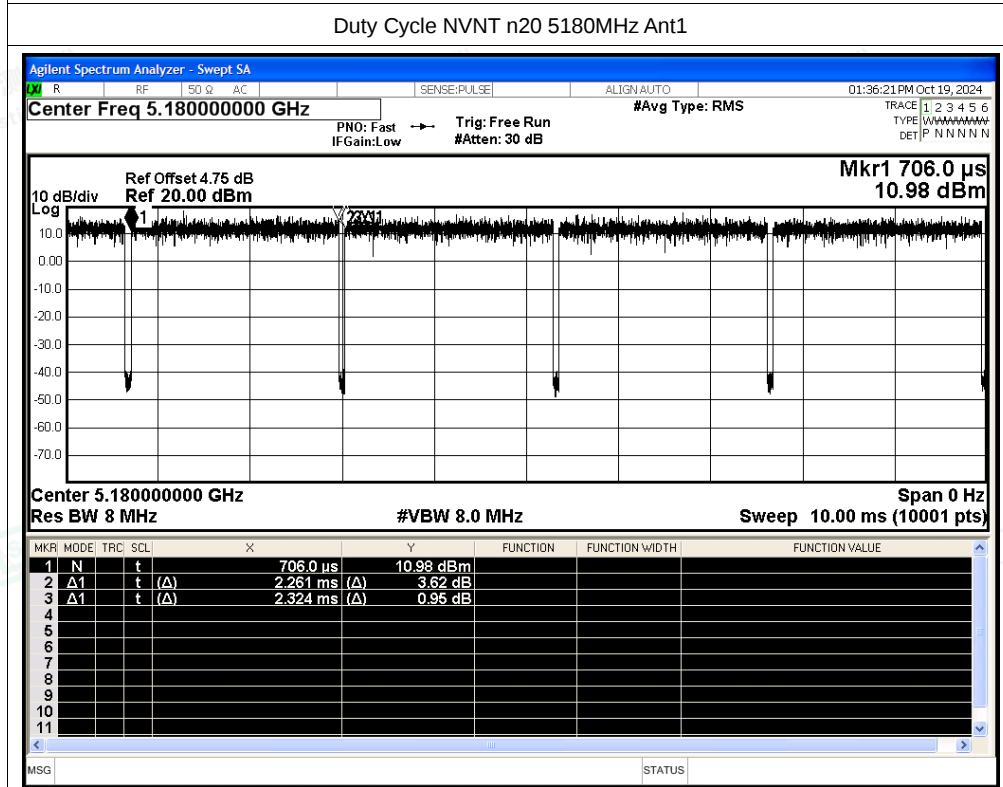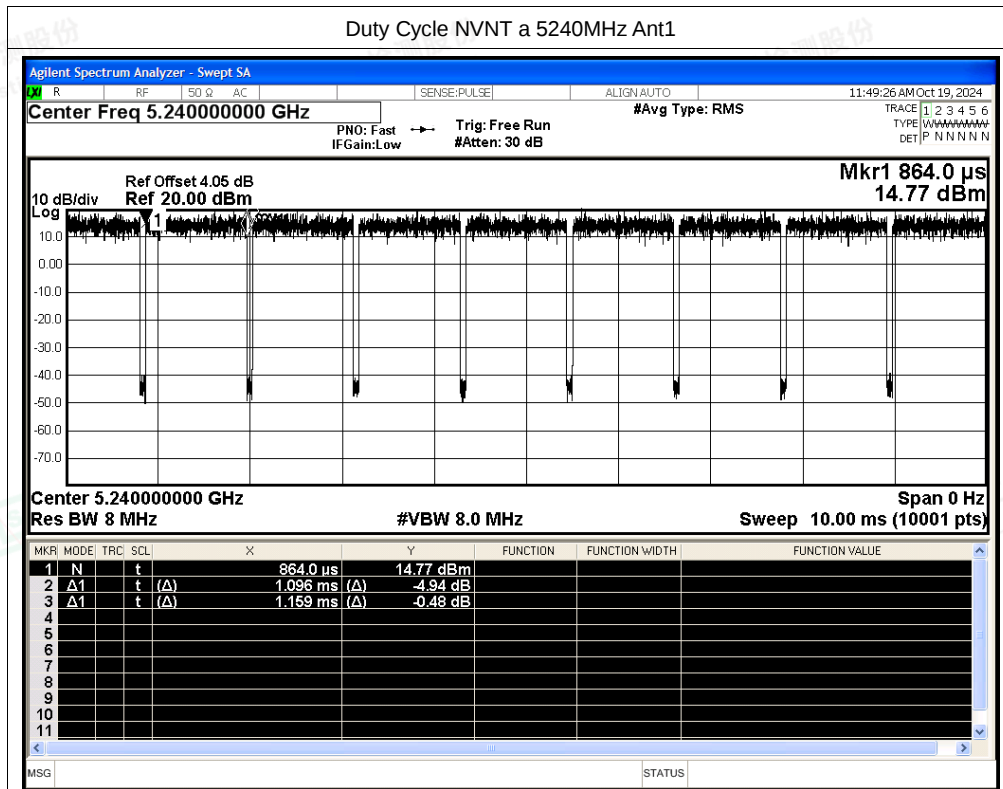

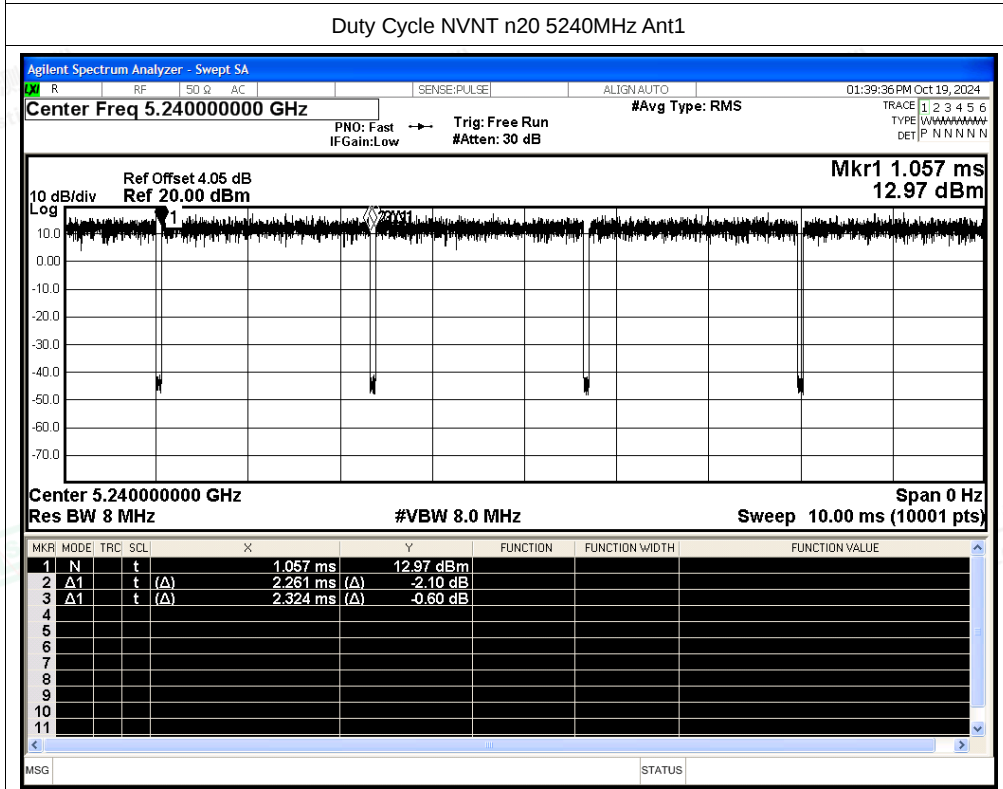
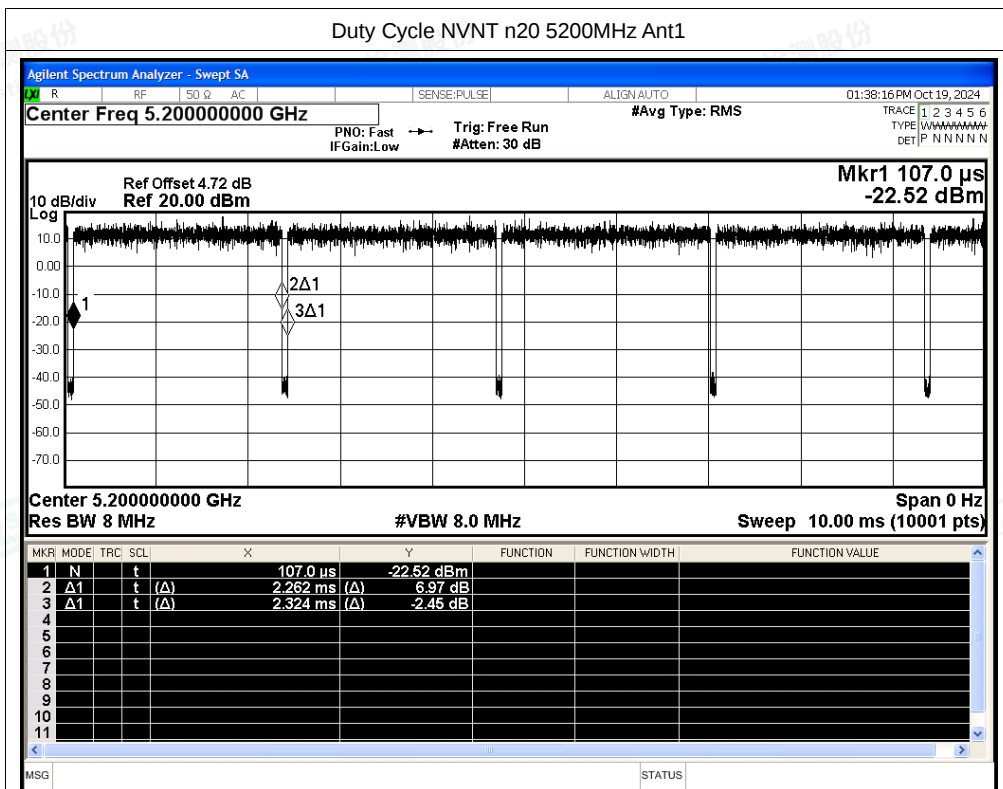




Shenzhen LCS Compliance Testing Laboratory Ltd.



Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

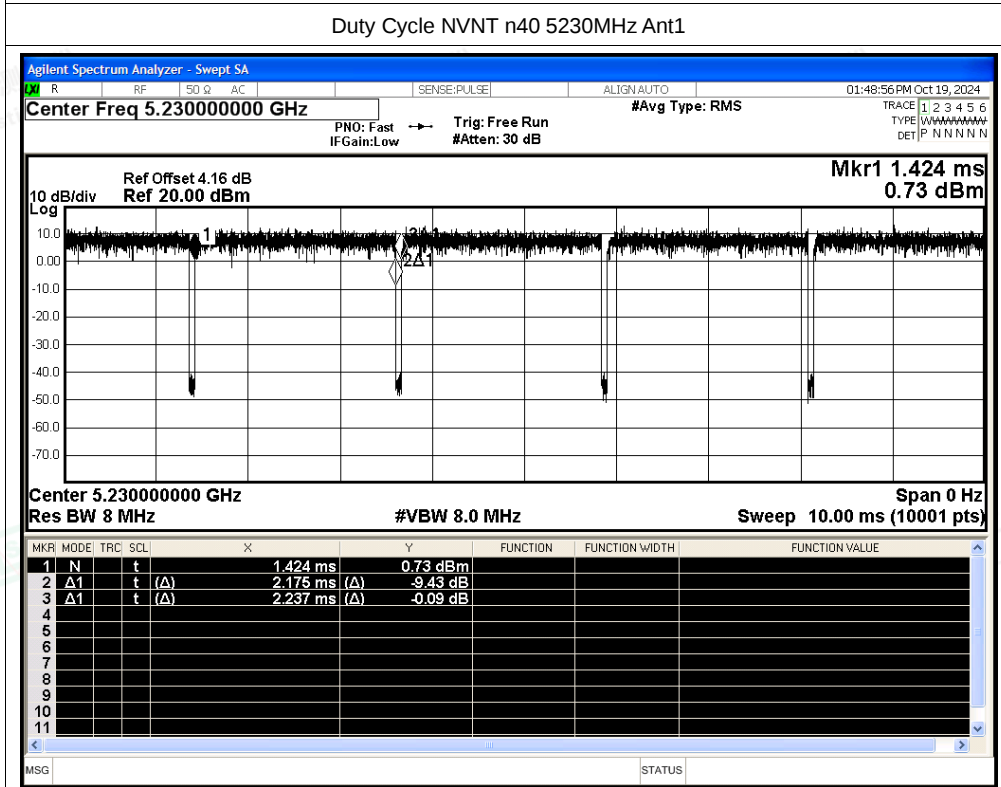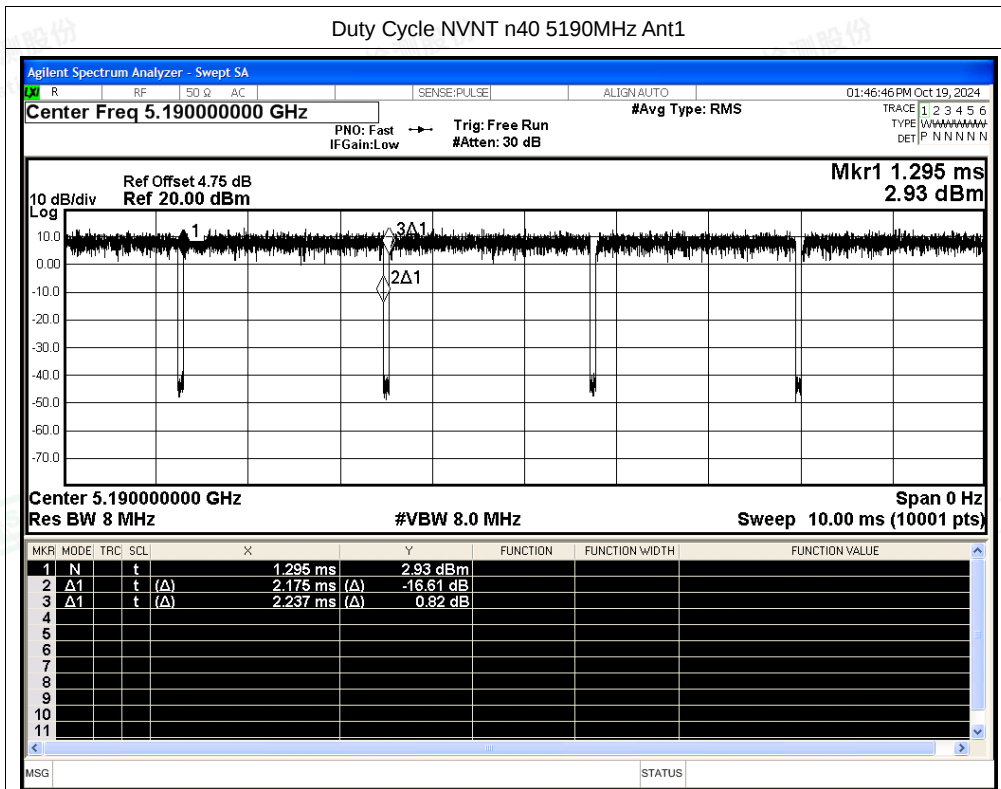

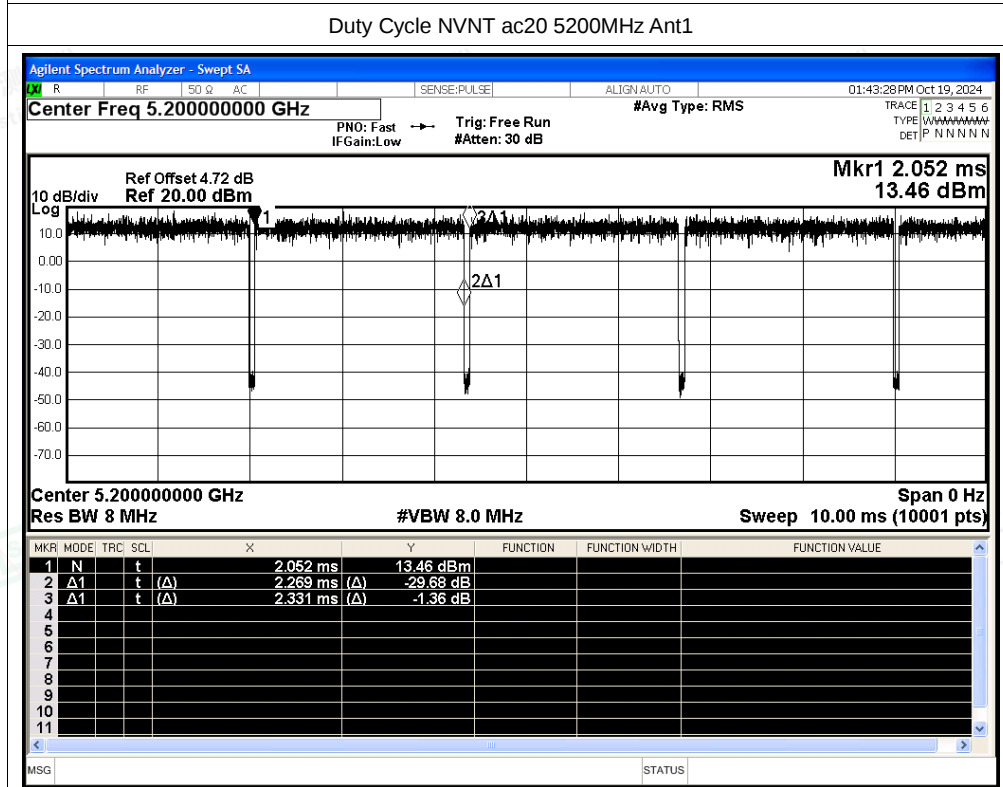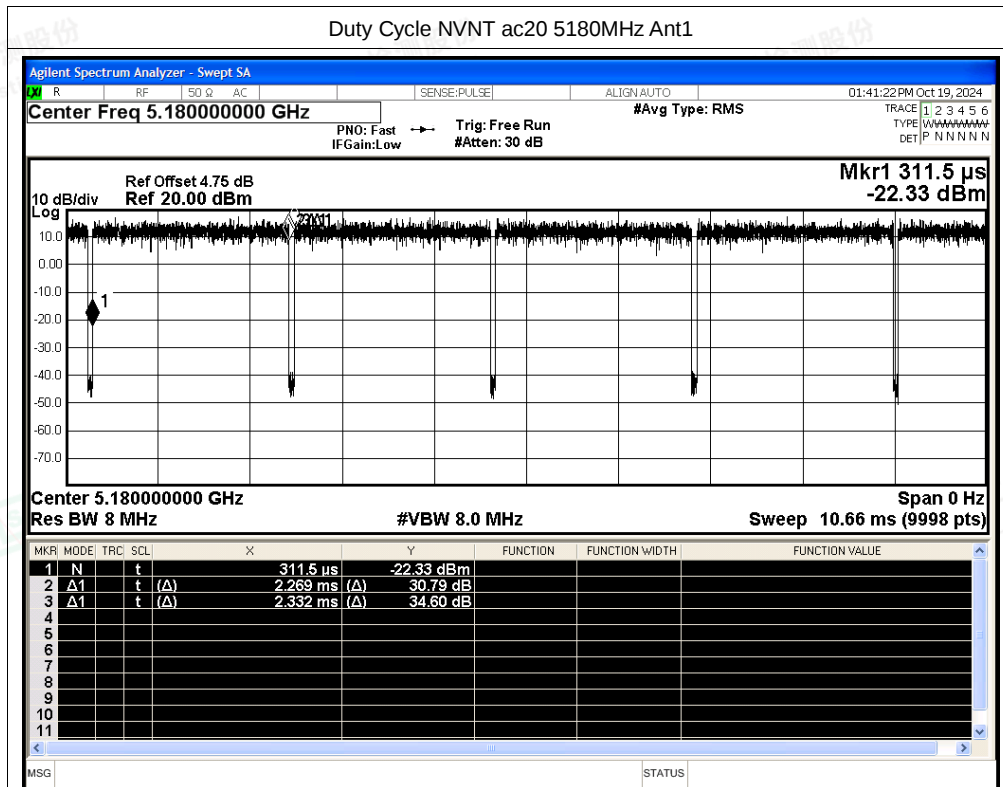

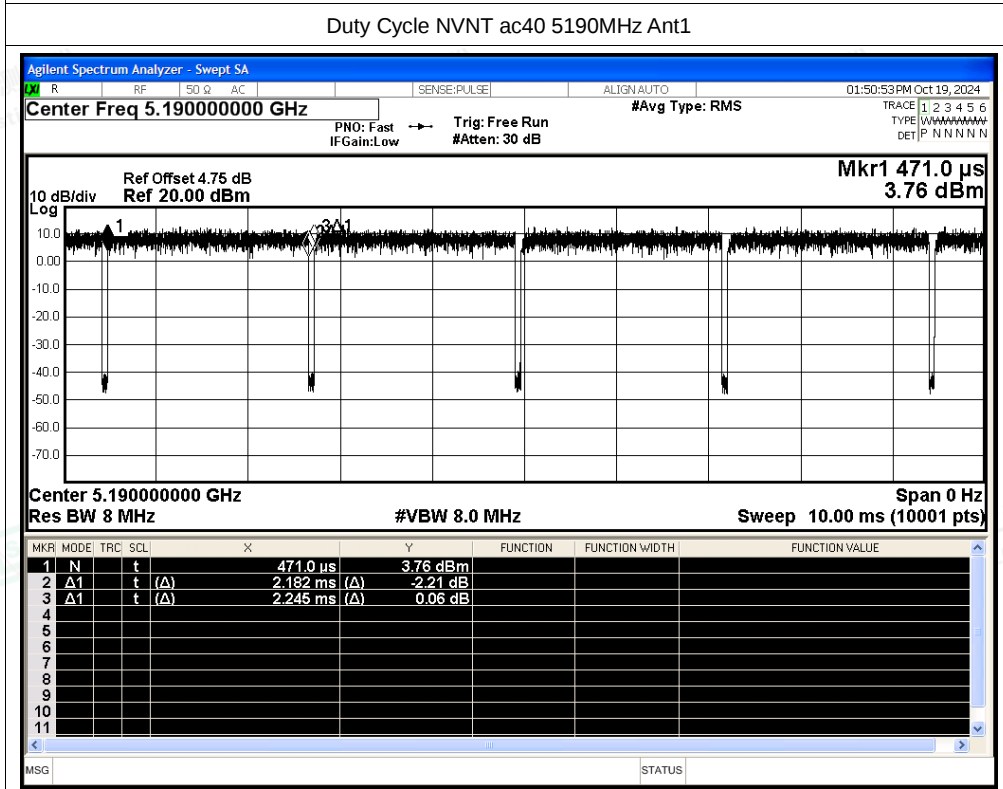
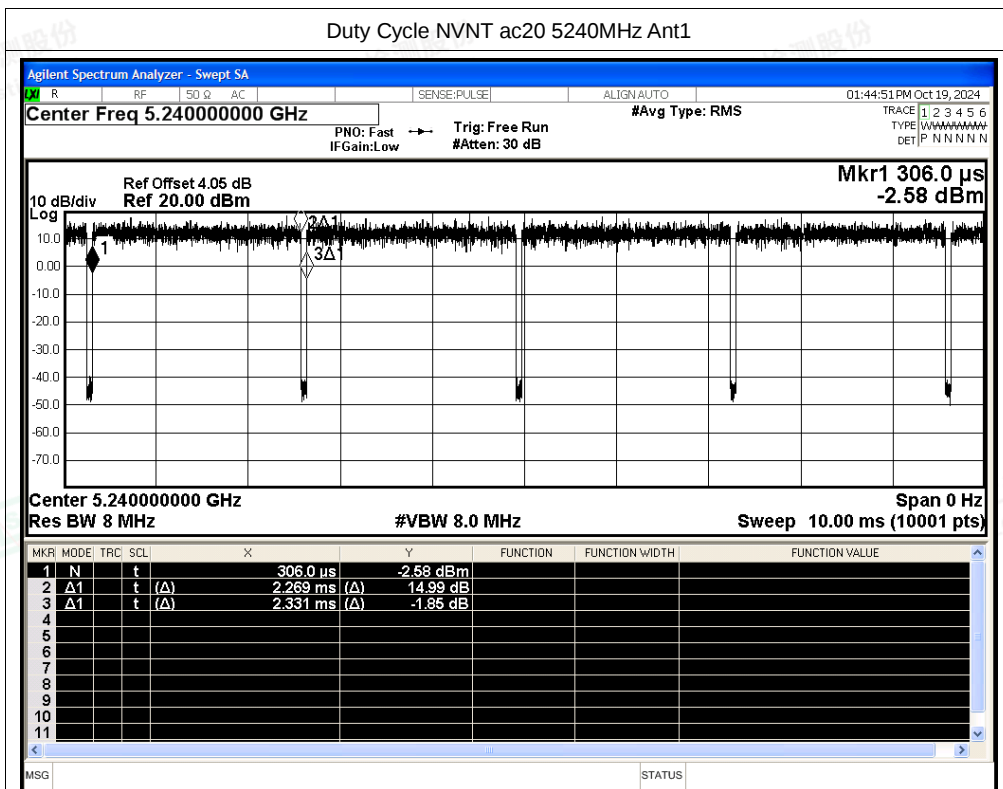


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

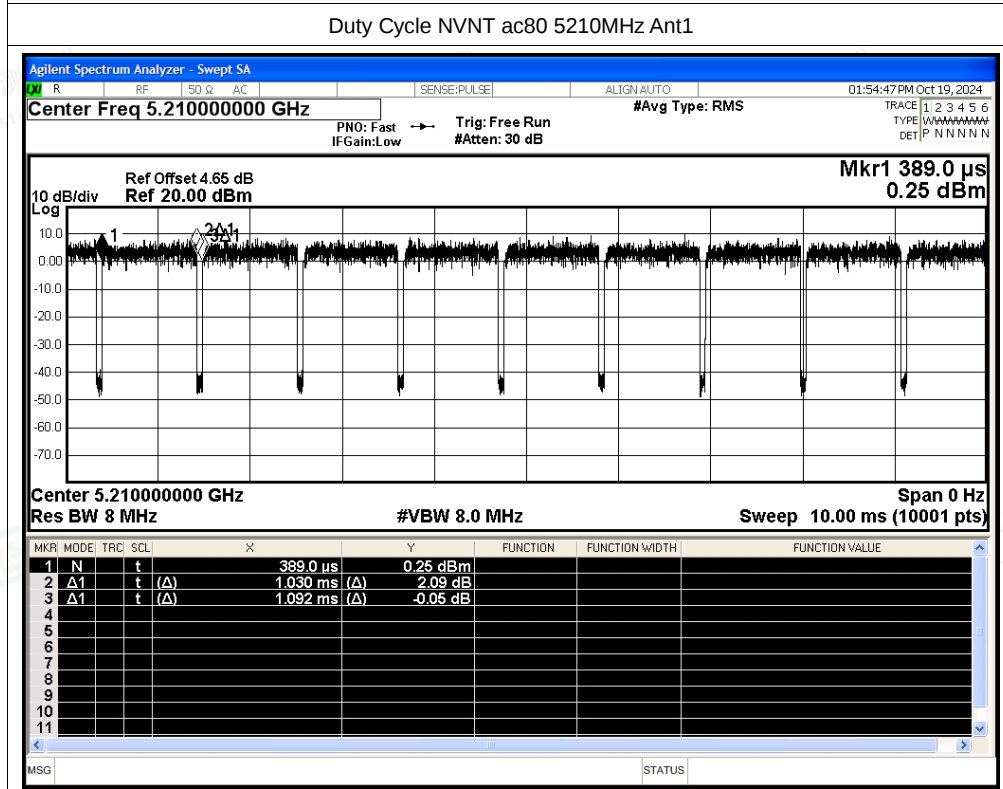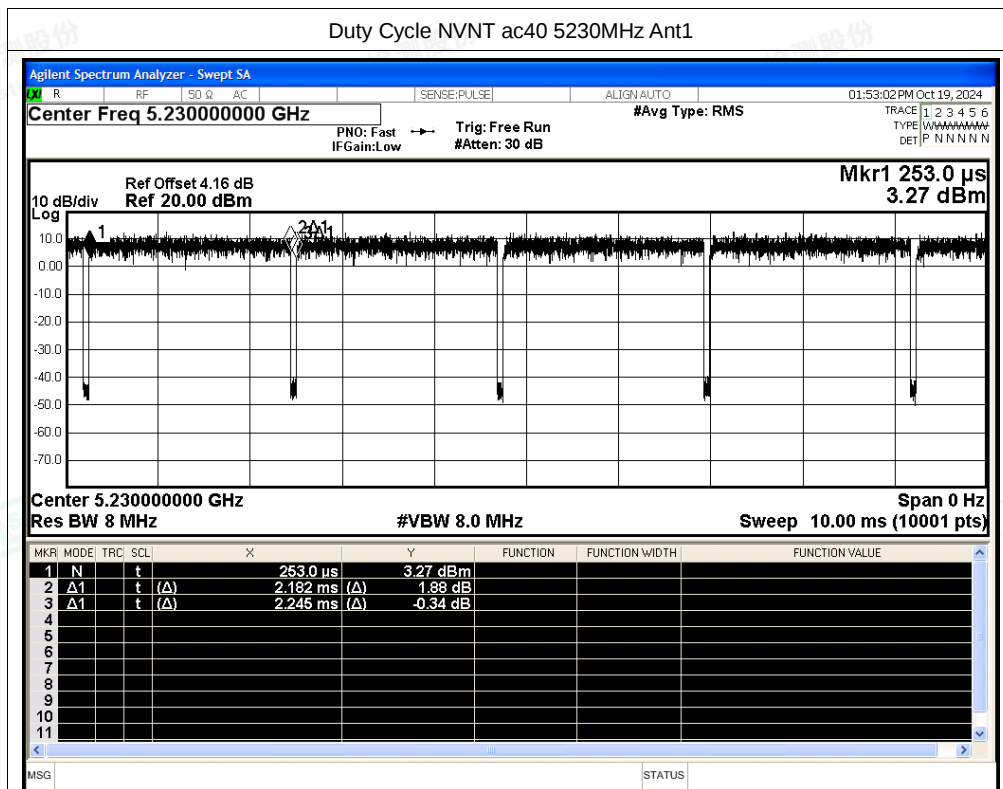

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5180	Ant2	94.57	0.24	0.91
NVNT	a	5200	Ant2	94.56	0.24	0.91
NVNT	a	5240	Ant2	94.65	0.24	0.91
NVNT	n20	5180	Ant2	97.29	0.12	0.44
NVNT	n20	5200	Ant2	97.29	0.12	0.44
NVNT	n20	5240	Ant2	97.29	0.12	0.44
NVNT	n40	5190	Ant2	94.71	0.24	0.9
NVNT	n40	5230	Ant2	94.71	0.24	0.9
NVNT	ac20	5180	Ant2	97.3	0.12	0.44
NVNT	ac20	5200	Ant2	97.34	0.12	0.44
NVNT	ac20	5240	Ant2	97.3	0.12	0.44
NVNT	ac40	5190	Ant2	94.72	0.24	0.9
NVNT	ac40	5230	Ant2	94.72	0.24	0.9
NVNT	ac80	5210	Ant2	89.65	0.47	1.86






Test Graphs

Duty Cycle NVNT a 5180MHz Ant2

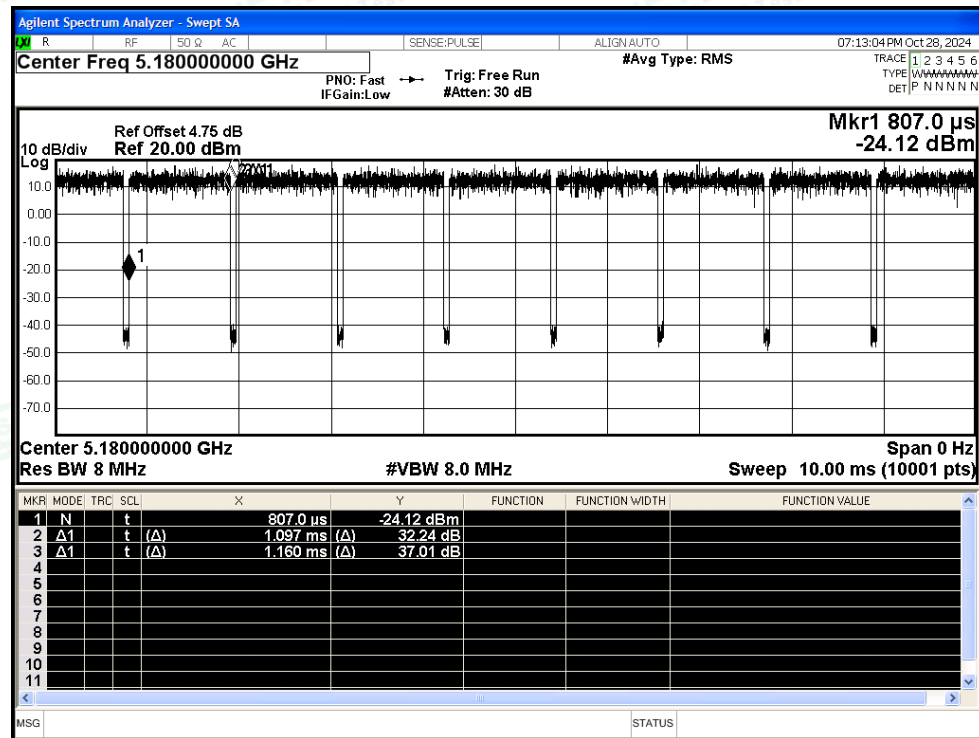

Duty Cycle NVNT a 5200MHz Ant2


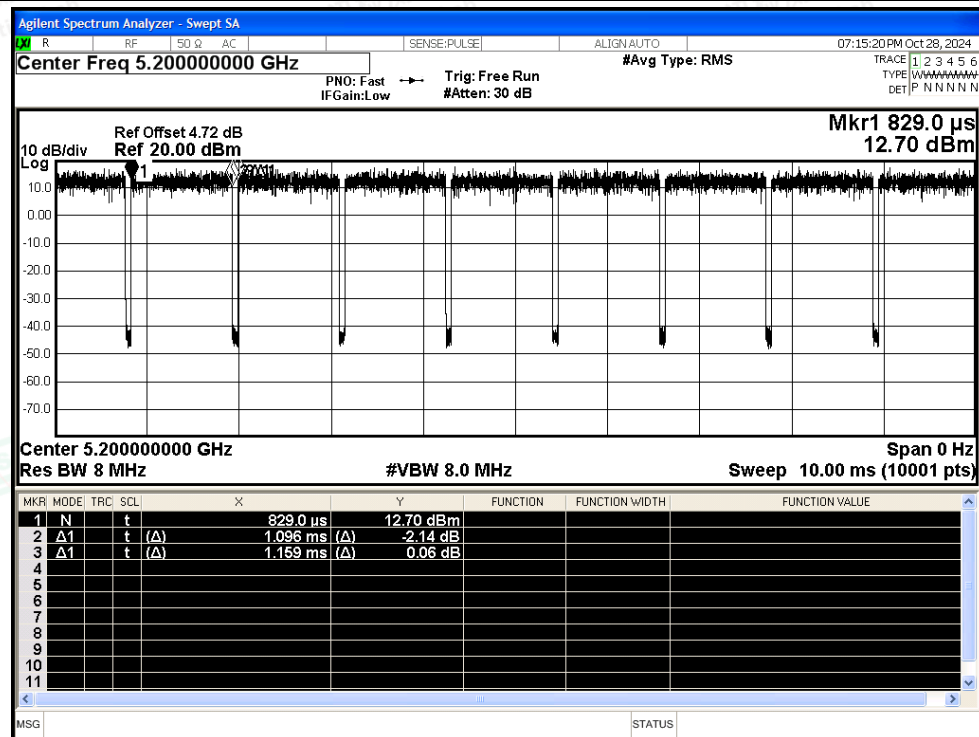


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

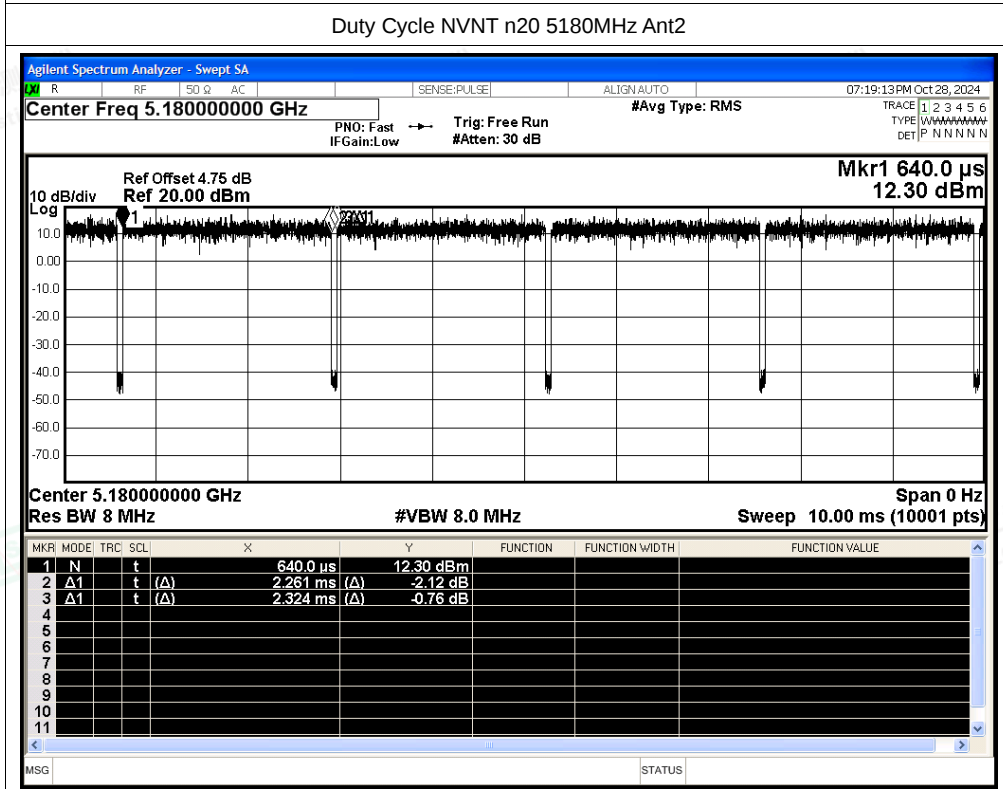
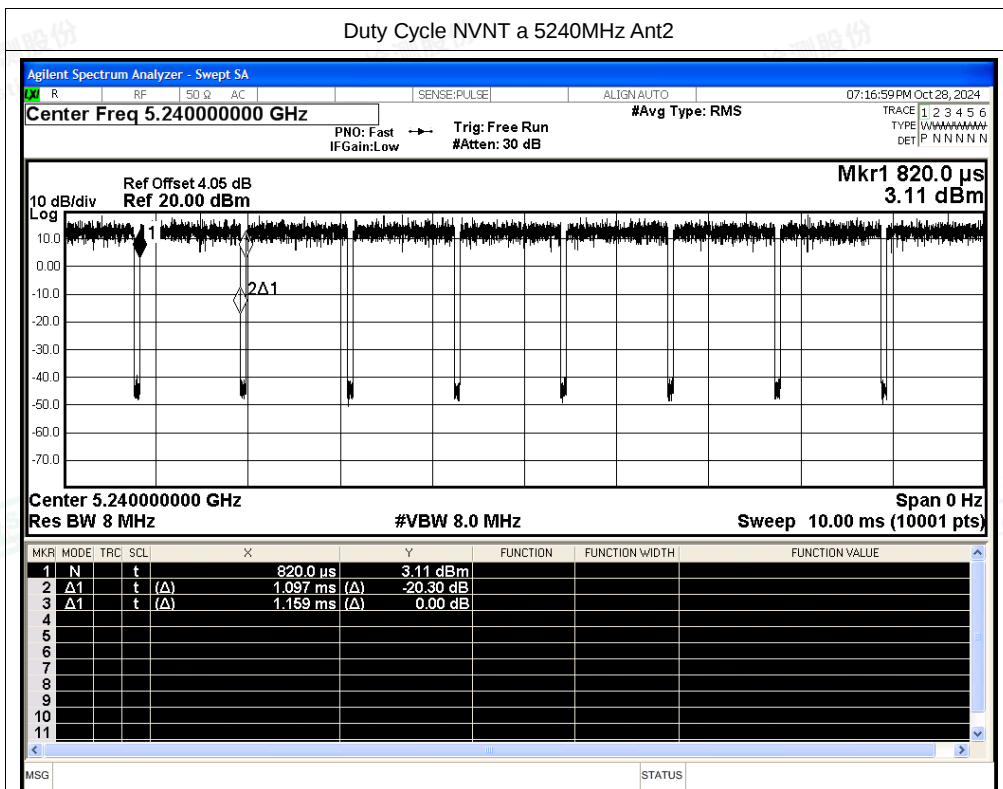


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

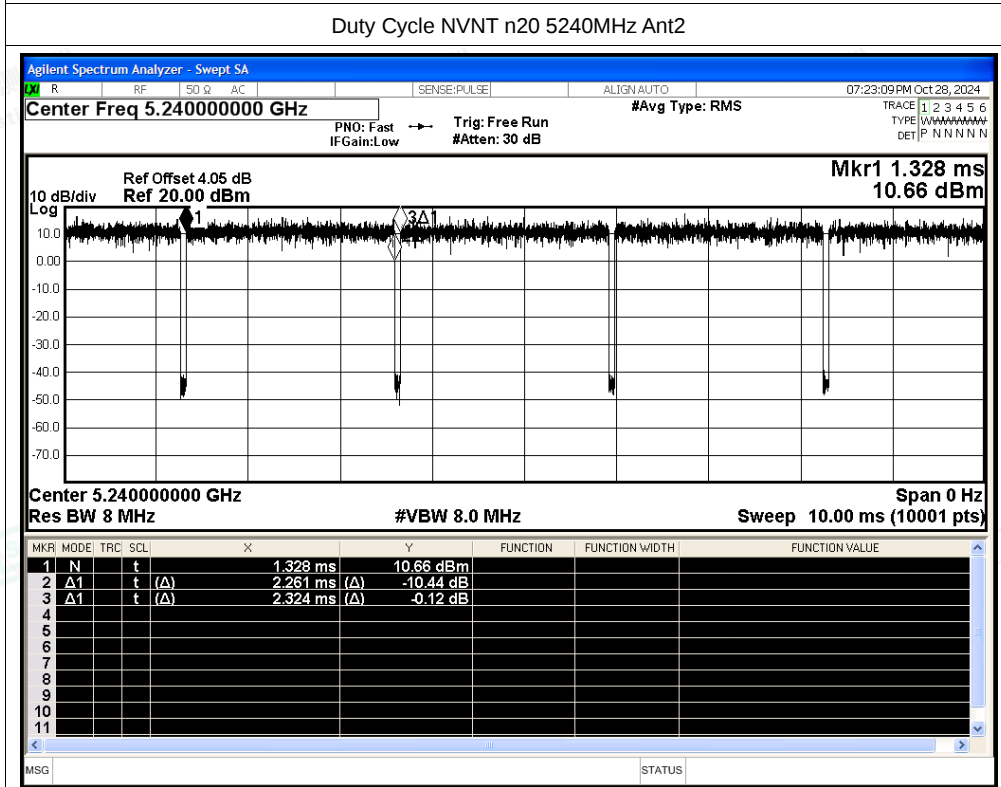
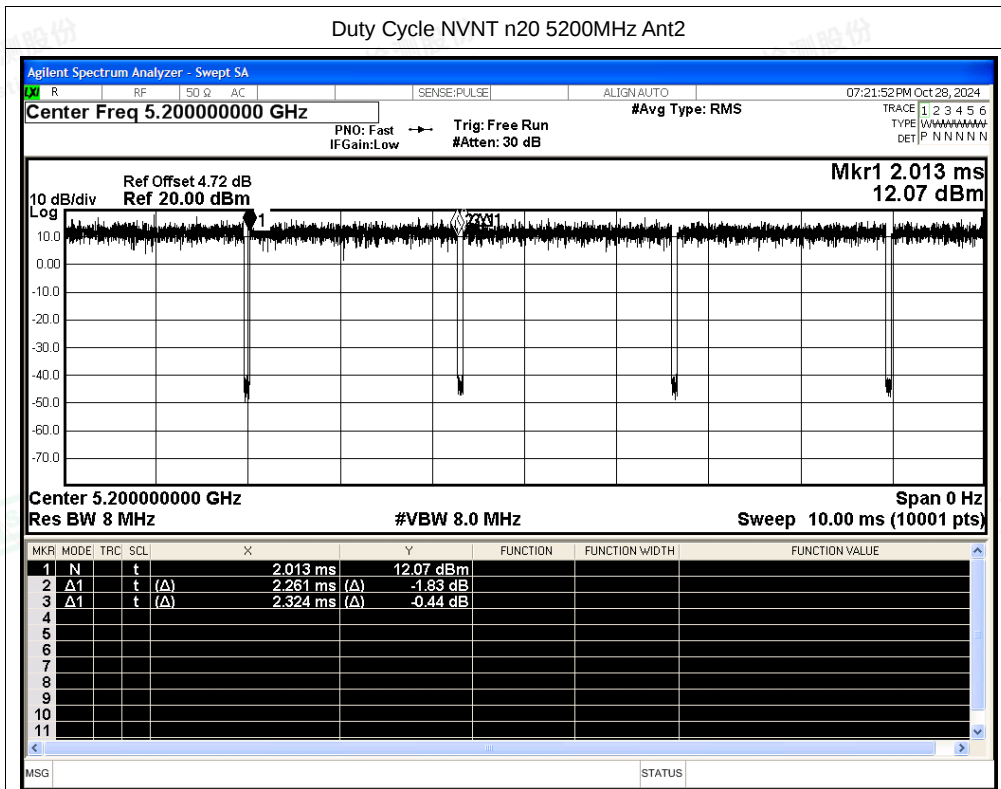


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

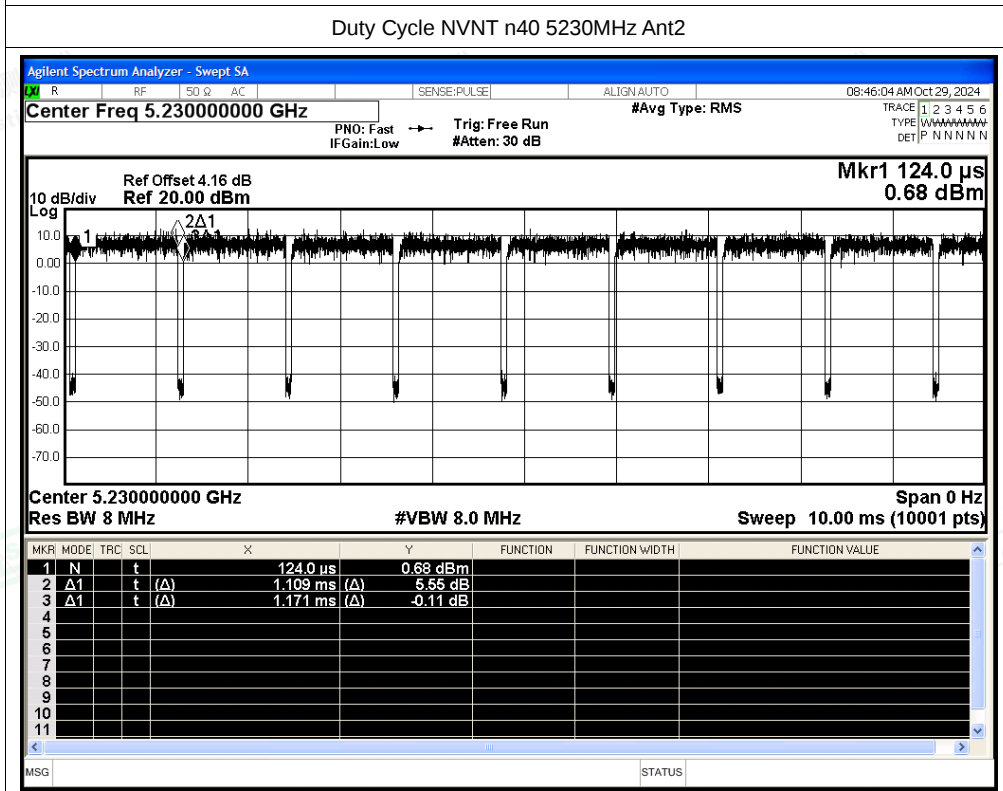
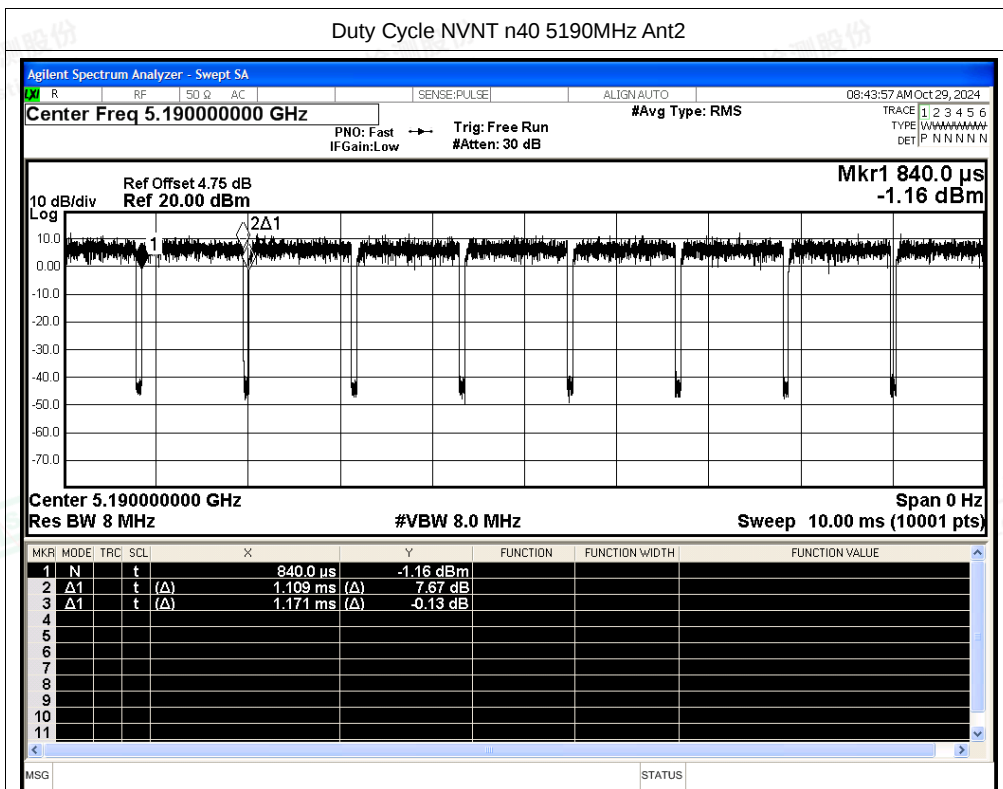


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

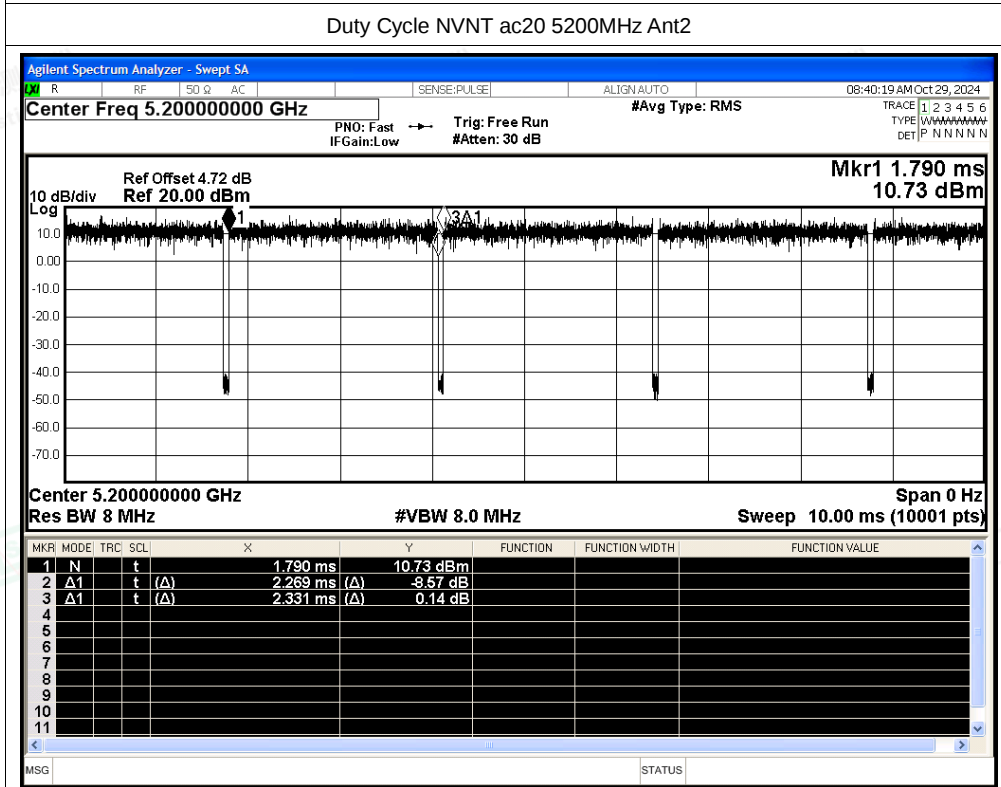
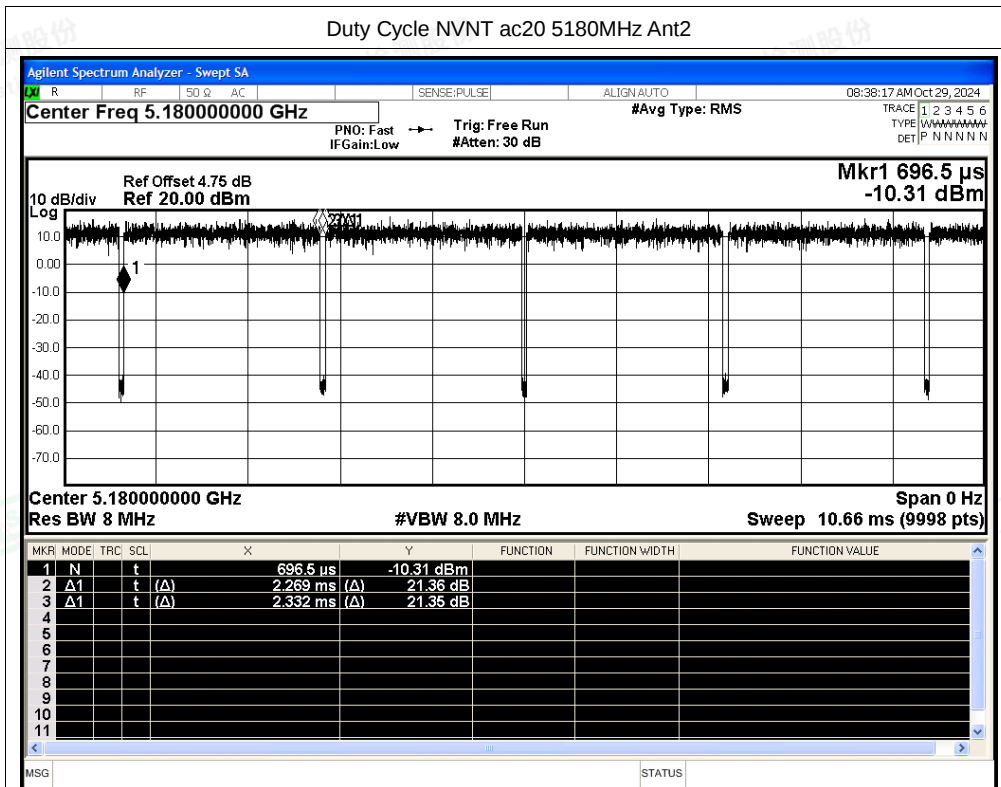




Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

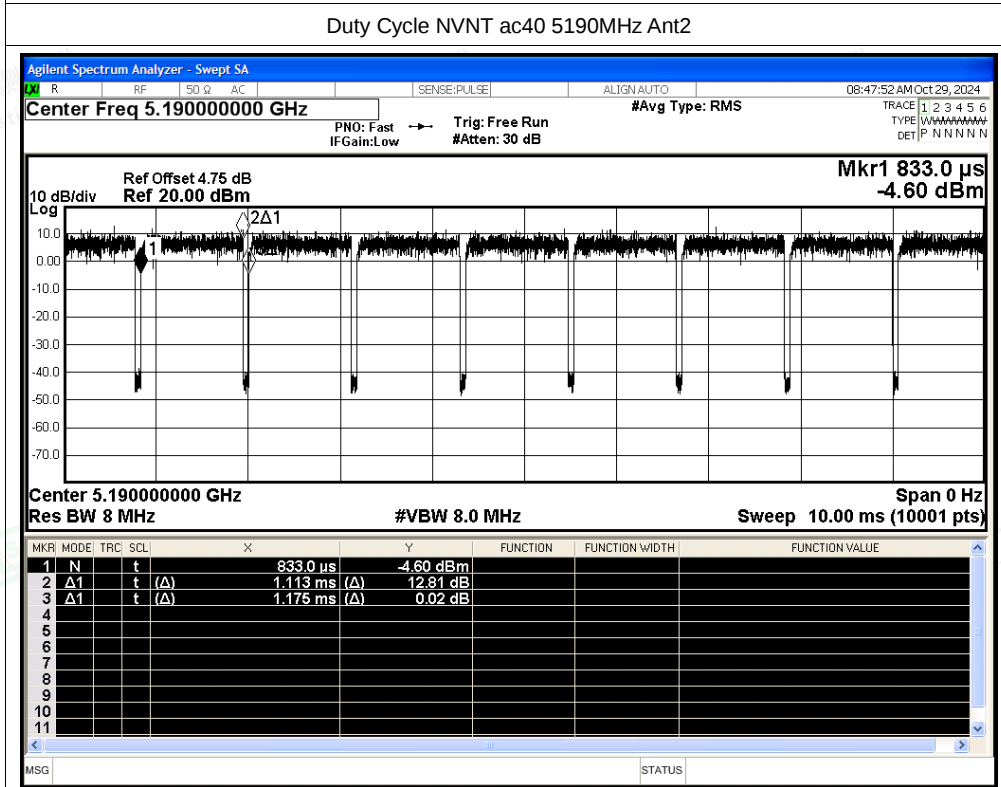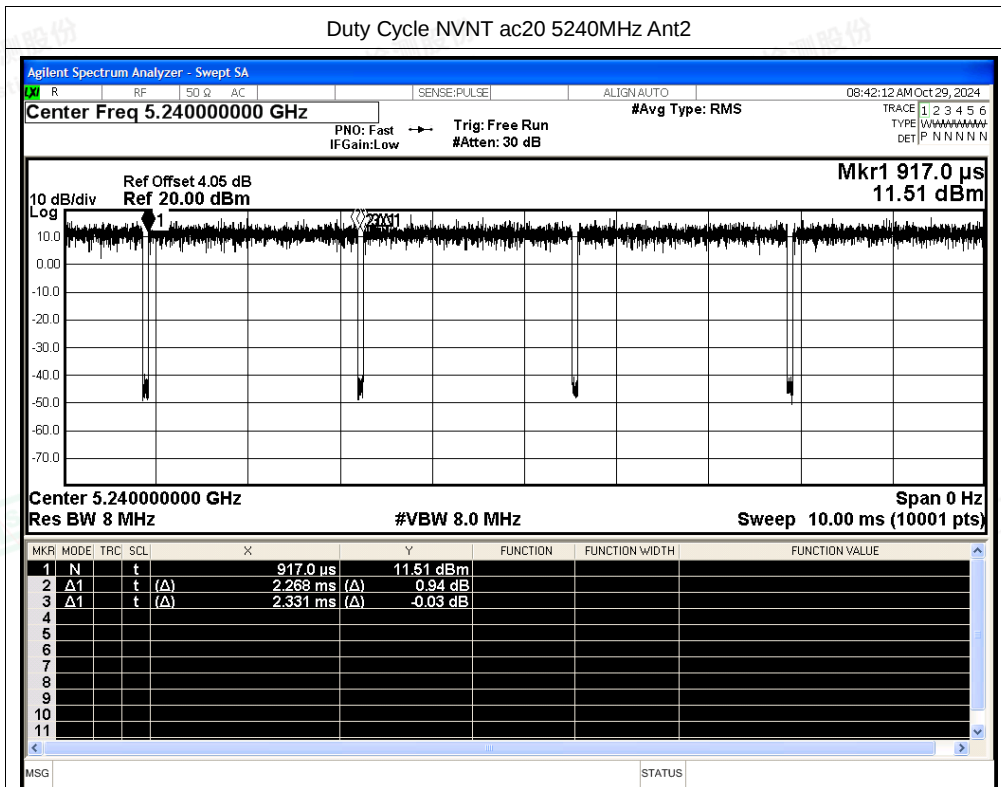

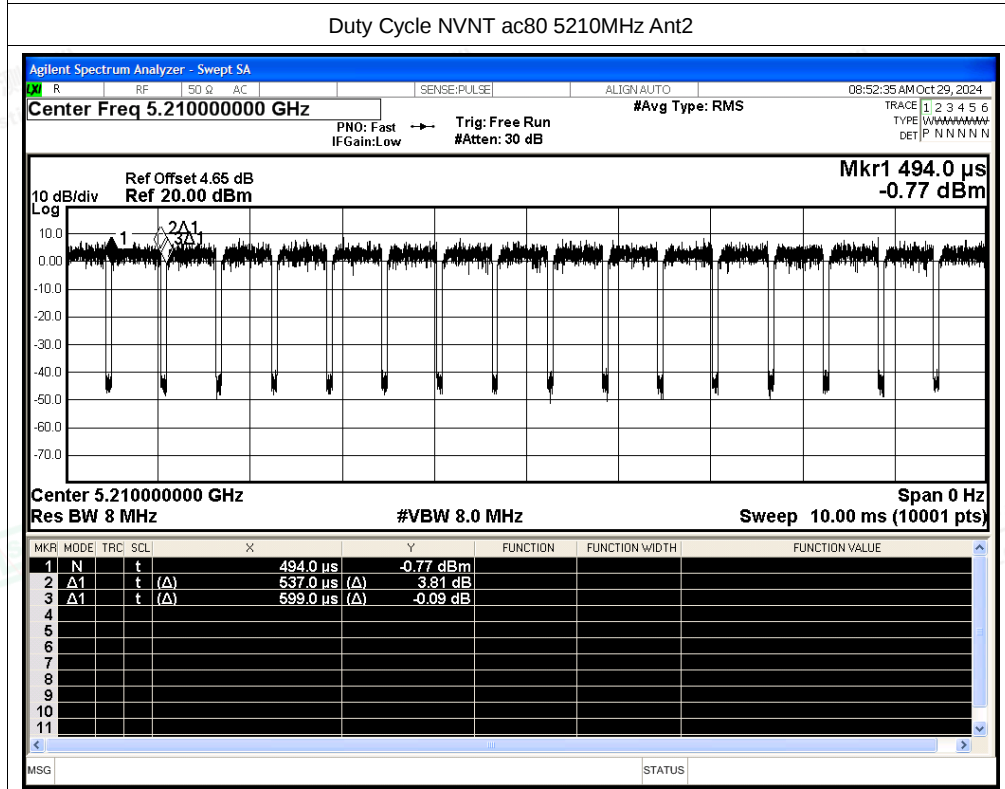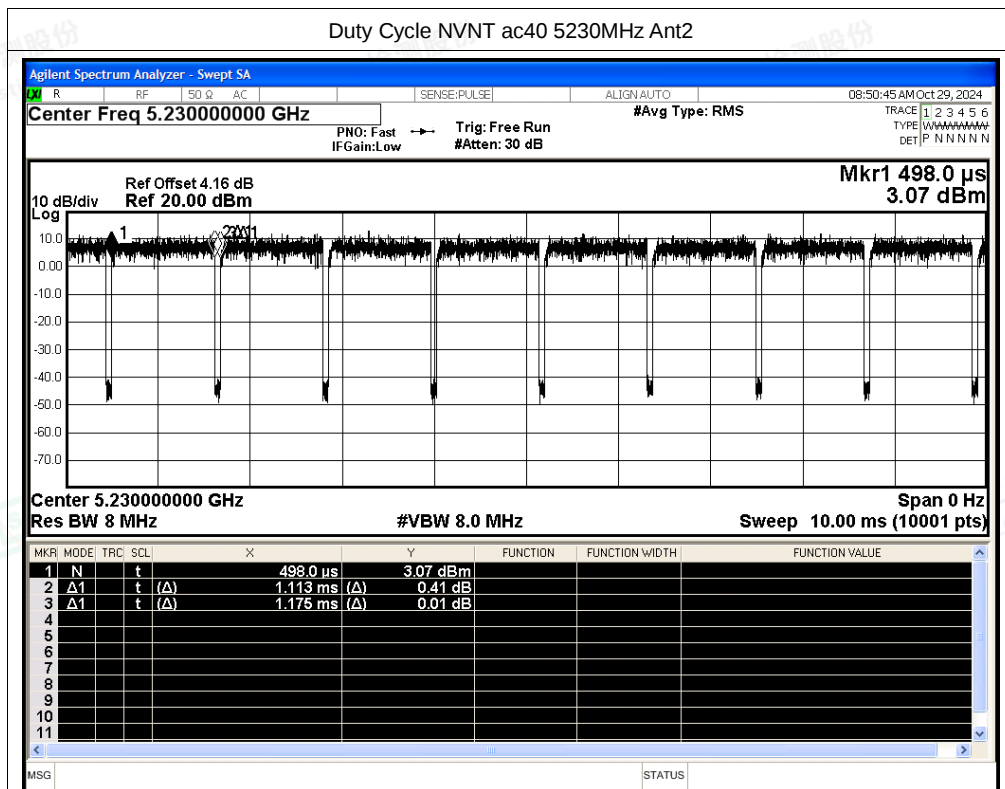

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity