

CONDUCTED SPURIOUS EMISSION TEST RESULT

TestMode	Antenna	Frequency[MHz]	FreqRange [Mhz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
11B	Ant W0	2412	Reference	8.32	8.32	---	PASS
			30~1000	8.32	-55.73	≤-21.68	PASS
			1000~26500	8.32	-35.98	≤-21.68	PASS
	Ant W1	2412	Reference	8.67	8.67	---	PASS
			30~1000	8.67	-57.3	≤-21.33	PASS
			1000~26500	8.67	-37.74	≤-21.33	PASS
	Ant W0	2437	Reference	8.74	8.74	---	PASS
			30~1000	8.74	-56.59	≤-21.26	PASS
			1000~26500	8.74	-37.01	≤-21.26	PASS
	Ant W1	2437	Reference	9.38	9.38	---	PASS
			30~1000	9.38	-57.16	≤-20.62	PASS
			1000~26500	9.38	-37.96	≤-20.62	PASS
	Ant W0	2462	Reference	8.81	8.81	---	PASS
			30~1000	8.81	-55.65	≤-21.19	PASS
			1000~26500	8.81	-36.45	≤-21.19	PASS
	Ant W1	2462	Reference	9.45	9.45	---	PASS
			30~1000	9.45	-56.98	≤-20.55	PASS
			1000~26500	9.45	-38.26	≤-20.55	PASS
11G	Ant W0	2412	Reference	3.56	3.56	---	PASS
			30~1000	3.56	-57.09	≤-26.44	PASS
			1000~26500	3.56	-36.88	≤-26.44	PASS
	Ant W1	2412	Reference	4.70	4.70	---	PASS
			30~1000	4.70	-57.41	≤-25.3	PASS
			1000~26500	4.70	-37.81	≤-25.3	PASS
	Ant W0	2437	Reference	3.45	3.45	---	PASS
			30~1000	3.45	-56.31	≤-26.55	PASS
			1000~26500	3.45	-35.88	≤-26.55	PASS
	Ant W1	2437	Reference	5.25	5.25	---	PASS
			30~1000	5.25	-57.45	≤-24.75	PASS
			1000~26500	5.25	-37.62	≤-24.75	PASS
	Ant W0	2462	Reference	5.43	5.43	---	PASS
			30~1000	5.43	-56.19	≤-24.57	PASS
			1000~26500	5.43	-37.11	≤-24.57	PASS
	Ant W1	2462	Reference	4.57	4.57	---	PASS
			30~1000	4.57	-57.32	≤-25.43	PASS
			1000~26500	4.57	-37.28	≤-25.43	PASS
11N20MIMO	Ant W0	2412	Reference	4.31	4.31	---	PASS
			30~1000	4.31	-56.07	≤-25.69	PASS
			1000~26500	4.31	-36.4	≤-25.69	PASS
	Ant W1	2412	Reference	4.52	4.52	---	PASS
			30~1000	4.52	-57.02	≤-25.48	PASS
			1000~26500	4.52	-36.53	≤-25.48	PASS
	Ant W0	2437	Reference	2.95	2.95	---	PASS
			30~1000	2.95	-57.03	≤-27.05	PASS



**BUREAU
VERITAS**

Reference No.: W7L-P24090006RF02


	Ant W1	2437	1000~26500	2.95	-37.91	≤ -27.05	PASS
			Reference	2.28	2.28	---	PASS
			30~1000	2.28	-56.84	≤ -27.72	PASS
			1000~26500	2.28	-37.55	≤ -27.72	PASS
	Ant W0	2462	Reference	2.11	2.11	---	PASS
			30~1000	2.11	-57.24	≤ -27.89	PASS
			1000~26500	2.11	-36.83	≤ -27.89	PASS
			Reference	4.31	4.31	---	PASS
	Ant W1	2462	30~1000	4.31	-55.69	≤ -25.69	PASS
			1000~26500	4.31	-37.9	≤ -25.69	PASS
			Reference	-4.38	-4.38	---	PASS
			30~1000	-4.38	-55.6	≤ -34.38	PASS
11N40MIMO	Ant W0	2422	1000~26500	-4.38	-36.91	≤ -34.38	PASS
			Reference	-3.92	-3.92	---	PASS
			30~1000	-3.92	-55.94	≤ -33.92	PASS
	Ant W1	2422	1000~26500	-3.92	-37.87	≤ -33.92	PASS
			Reference	-1.38	-1.38	---	PASS
			30~1000	-1.38	-56.91	≤ -31.38	PASS
	Ant W0	2437	1000~26500	-1.38	-36.52	≤ -31.38	PASS
			Reference	-0.85	-0.85	---	PASS
			30~1000	-0.85	-56.72	≤ -30.85	PASS
	Ant W1	2437	1000~26500	-0.85	-37.56	≤ -30.85	PASS
			Reference	-3.04	-3.04	---	PASS
			30~1000	-3.04	-57.34	≤ -33.04	PASS
	Ant W0	2452	1000~26500	-3.04	-37.12	≤ -33.04	PASS
			Reference	-1.33	-1.33	---	PASS
			30~1000	-1.33	-56.69	≤ -31.33	PASS
	Ant W1	2452	1000~26500	-1.33	-35.99	≤ -31.33	PASS
			Reference	2.70	2.70	---	PASS
			30~1000	2.70	-55.78	≤ -27.3	PASS
	Ant W0	2412	1000~26500	2.70	-36.39	≤ -27.3	PASS
			Reference	4.86	4.86	---	PASS
			30~1000	4.86	-56.72	≤ -25.14	PASS
	Ant W1	2412	1000~26500	4.86	-37.23	≤ -25.14	PASS
			Reference	1.54	1.54	---	PASS
			30~1000	1.54	-55.87	≤ -28.46	PASS
	Ant W0	2437	1000~26500	1.54	-37.25	≤ -28.46	PASS
			Reference	1.75	1.75	---	PASS
			30~1000	1.75	-56.72	≤ -28.25	PASS
	Ant W1	2437	1000~26500	1.75	-37.25	≤ -28.25	PASS
			Reference	2.97	2.97	---	PASS
			30~1000	2.97	-56.51	≤ -27.03	PASS
	Ant W0	2462	1000~26500	2.97	-36.99	≤ -27.03	PASS
			Reference	3.73	3.73	---	PASS
			30~1000	3.73	-56.91	≤ -26.27	PASS
	Ant W1	2462	1000~26500	3.73	-37.66	≤ -26.27	PASS
11AX40MIMO	Ant W0	2422	Reference	-0.09	-0.09	---	PASS
			30~1000	-0.09	-55.87	≤ -30.09	PASS
			1000~26500	-0.09	-37.12	≤ -30.09	PASS
	Ant W1	2422	Reference	-0.22	-0.22	---	PASS
			30~1000	-0.22	-56.57	≤ -30.22	PASS
			1000~26500	-0.22	-37.48	≤ -30.22	PASS



Reference No.: W7L-P24090006RF02

	Ant W0	2437	Reference	0.32	0.32	---	PASS
			30~1000	0.32	-56.62	≤ -29.68	PASS
			1000~26500	0.32	-37.18	≤ -29.68	PASS
	Ant W1	2437	Reference	0.39	0.39	---	PASS
			30~1000	0.39	-57.19	≤ -29.61	PASS
			1000~26500	0.39	-37.64	≤ -29.61	PASS
	Ant W0	2452	Reference	-2.91	-2.91	---	PASS
			30~1000	-2.91	-56.83	≤ -32.91	PASS
			1000~26500	-2.91	-37.11	≤ -32.91	PASS
	Ant W1	2452	Reference	-2.11	-2.11	---	PASS
			30~1000	-2.11	-56.99	≤ -32.11	PASS
			1000~26500	-2.11	-37.68	≤ -32.11	PASS


TEST GRAPHS

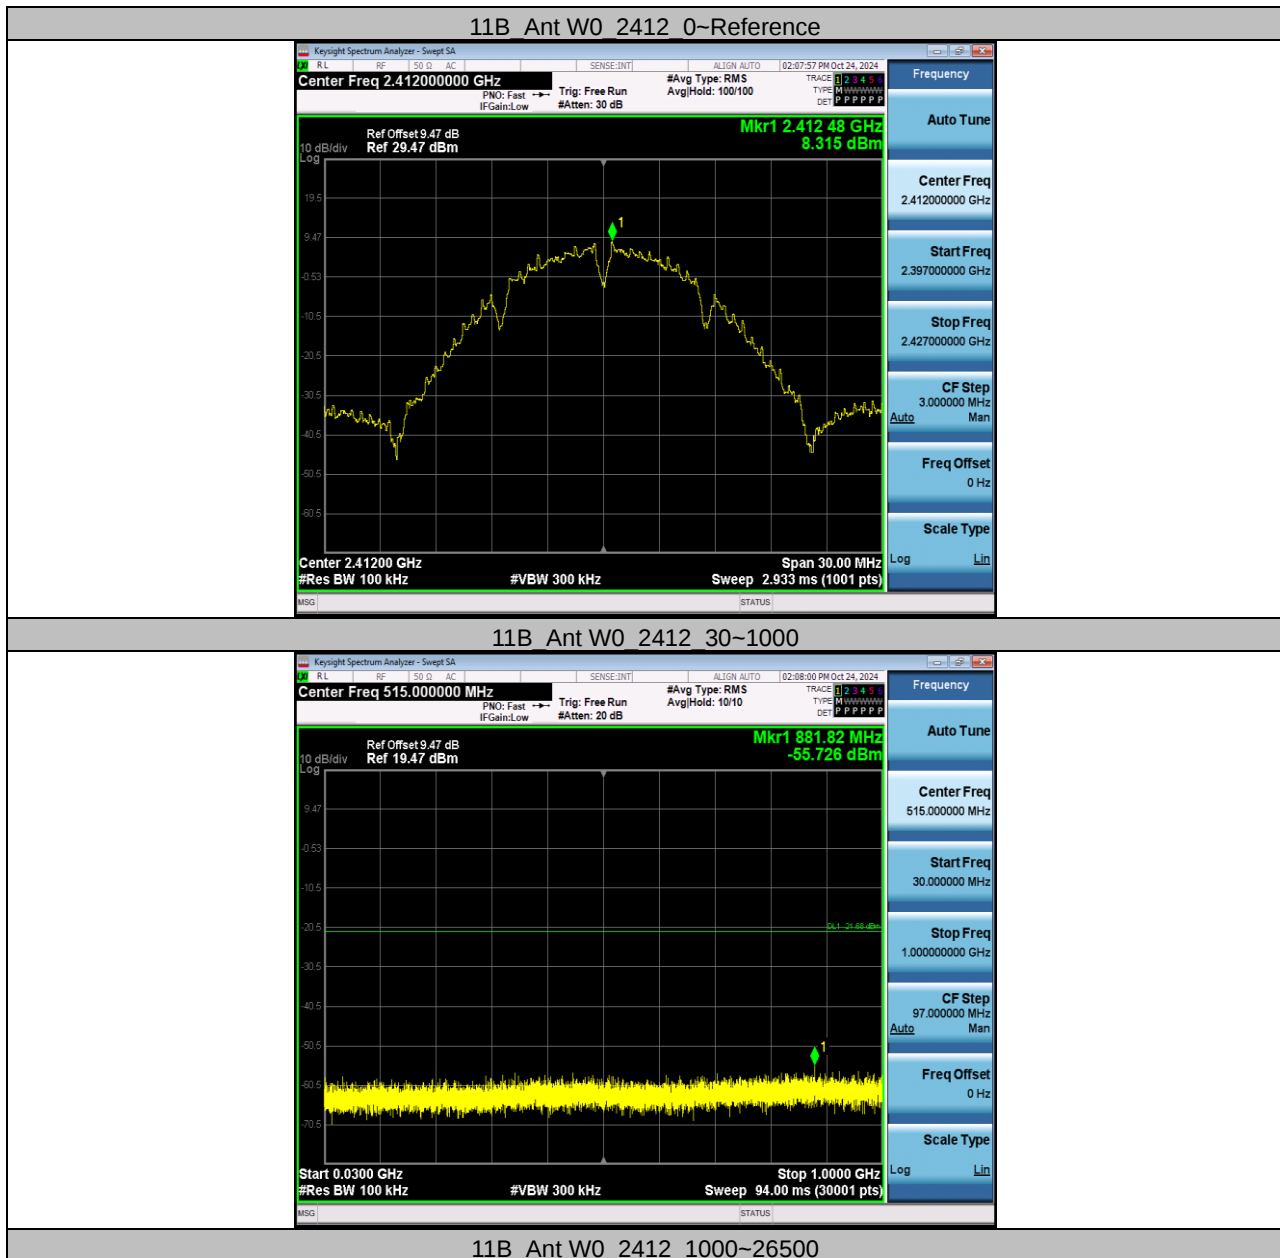



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

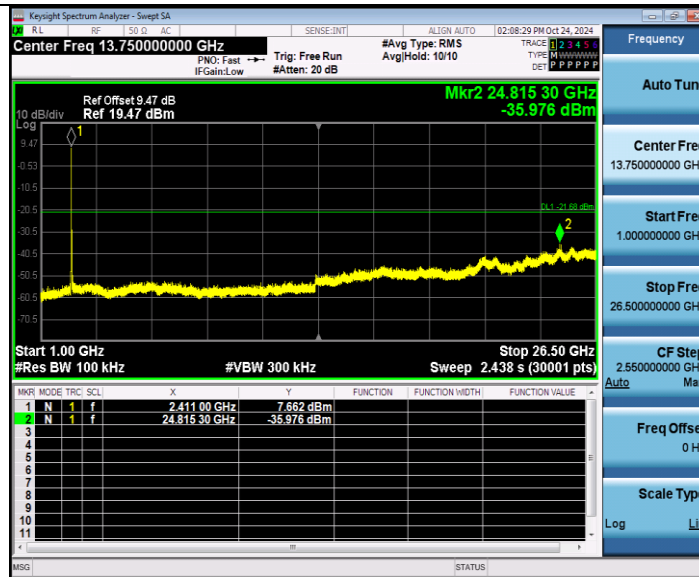

11B Ant W1 2412 0~Reference




11B Ant W1 2412 30~1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

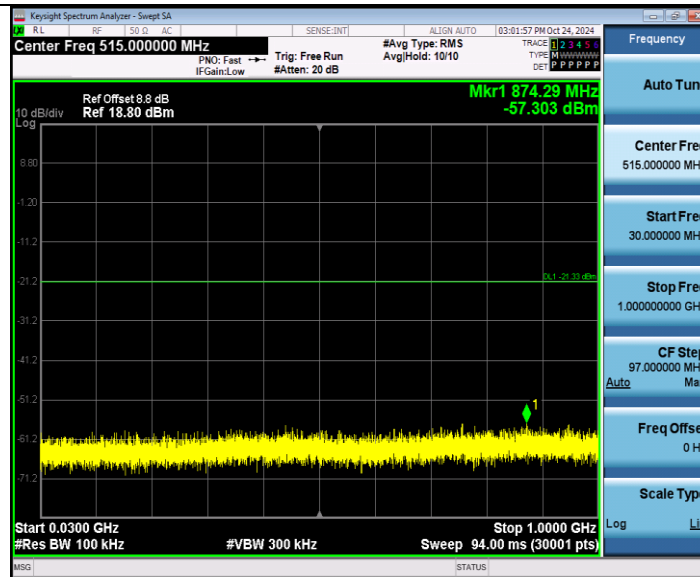

11B_Ant W1 2412 1000~26500

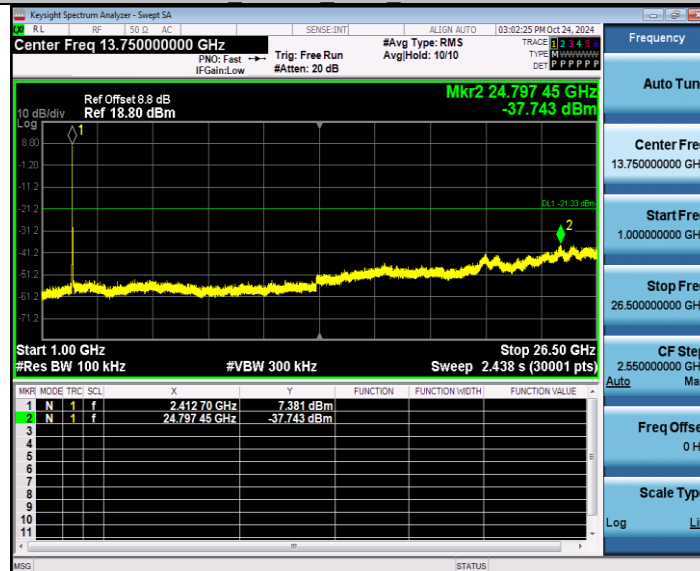

11B_Ant W0 2437 0~Reference




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11B_Ant W0_2437_30~1000

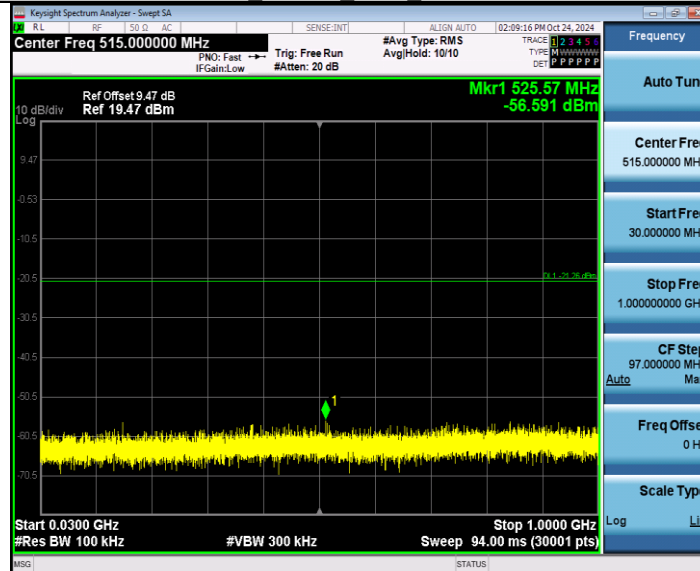


11B_Ant W0_2437_1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

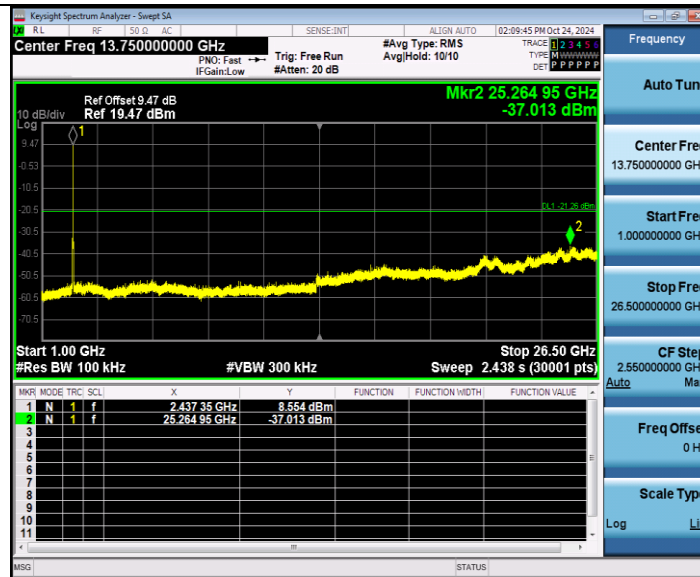

11B Ant W1 2437 0~Reference




11B Ant W1 2437 30~1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

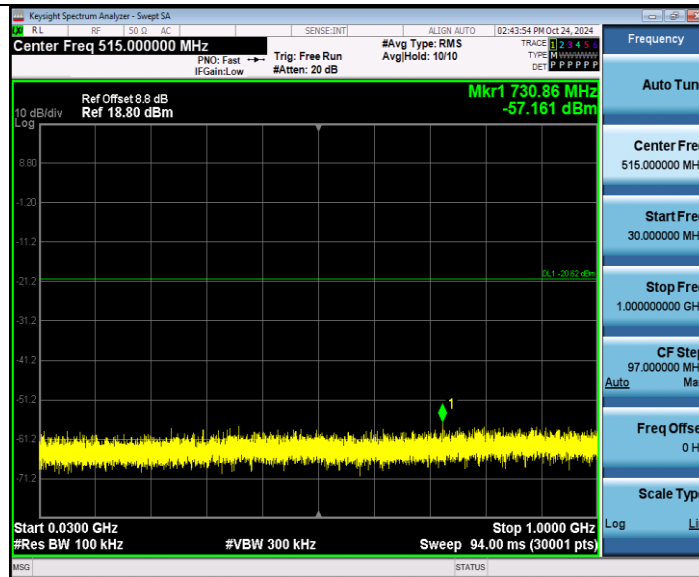

11B_Ant W1 2437 1000~26500

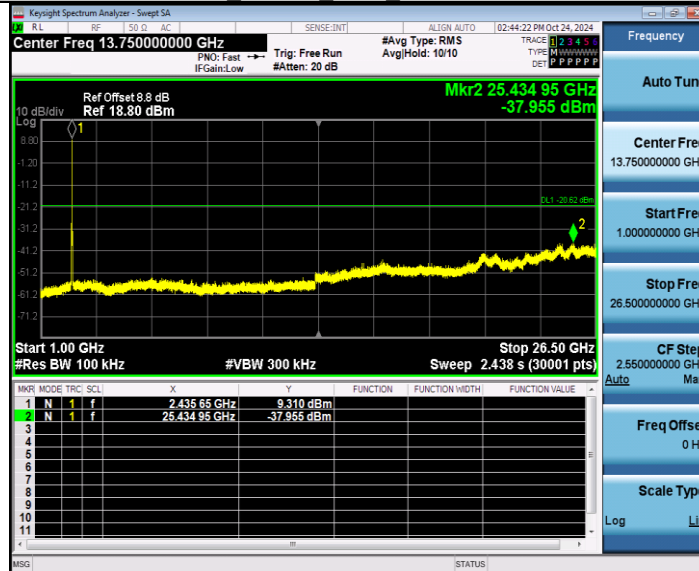

11B_Ant W0 2462 0~Reference




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11B_Ant W0_2462_30~1000

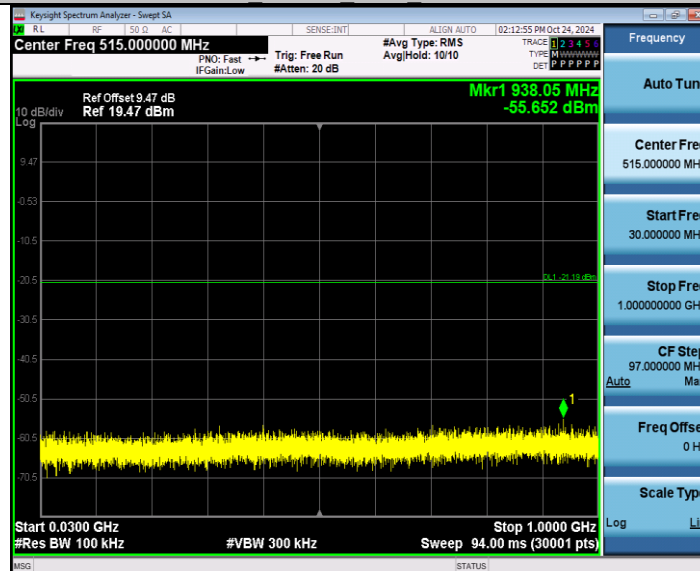


11B_Ant W0_2462_1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

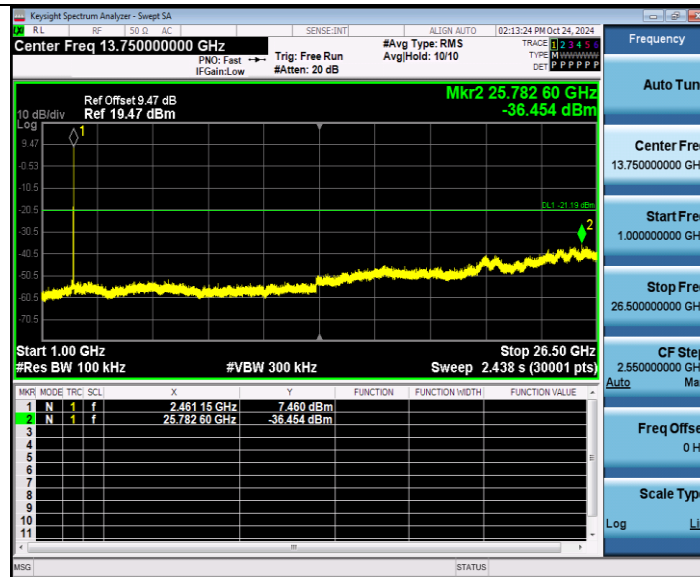

11B Ant W1 2462 0~Reference




11B Ant W1 2462 30~1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

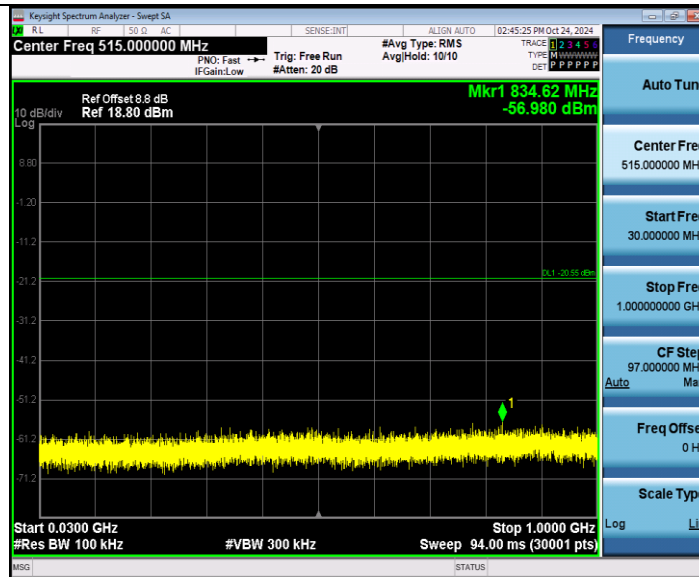

11B_Ant W1_2462_1000~26500

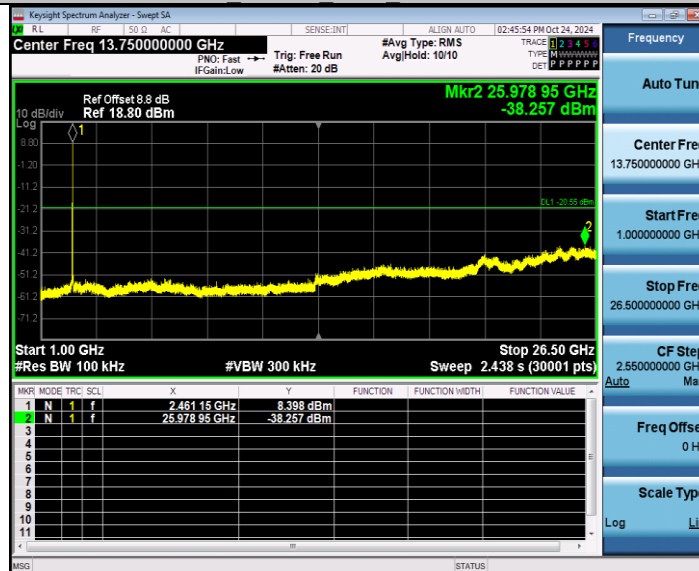

11G_Ant W0_2412_0~Reference




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11G Ant W0_2412_30~1000

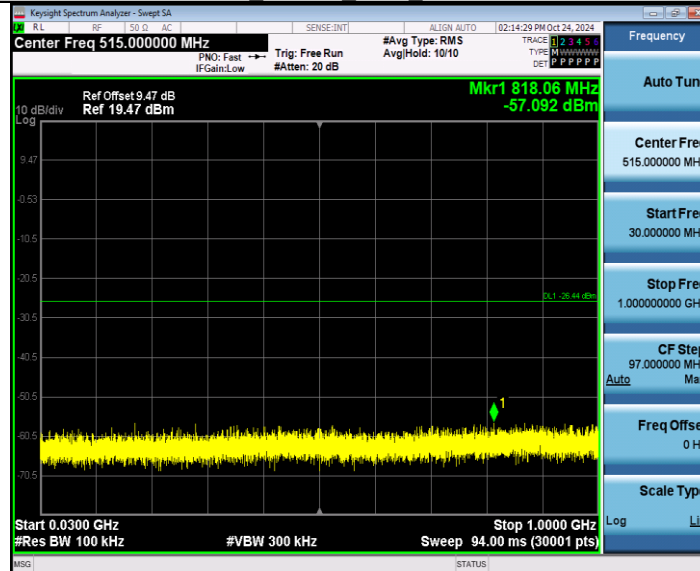


11G_Ant W0_2412_1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

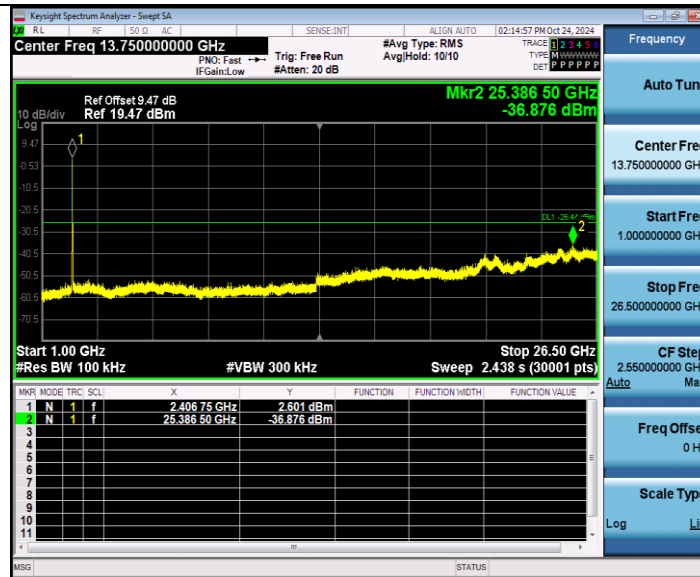

11G Ant W1 2412 0~Reference



11G Ant W1 2412 30~1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11G_Ant W1_2412_1000~26500

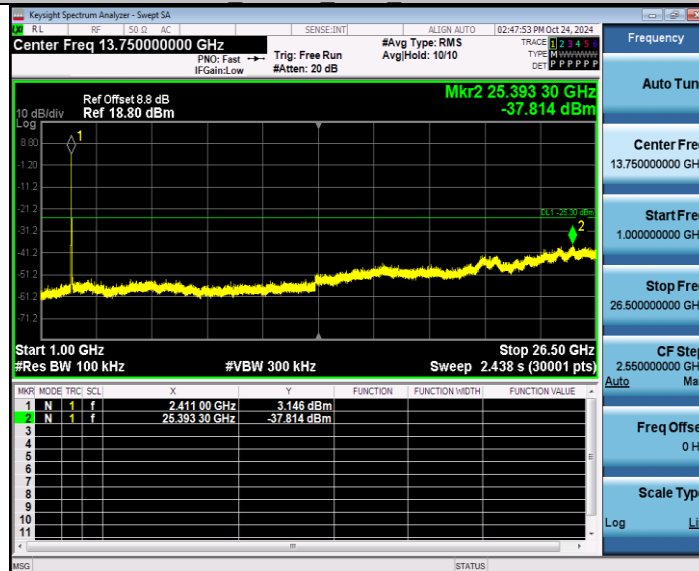

11G_Ant W0_2437_0~Reference




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11G Ant W0 2437 30~1000

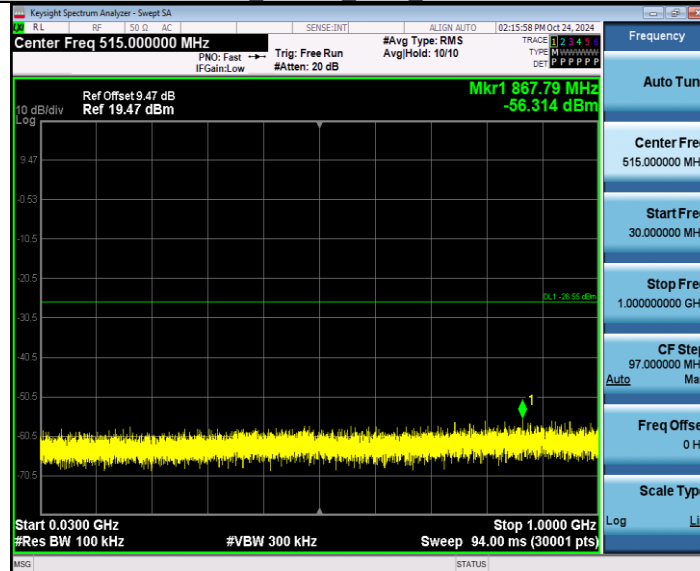


11G Ant W0 2437 1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

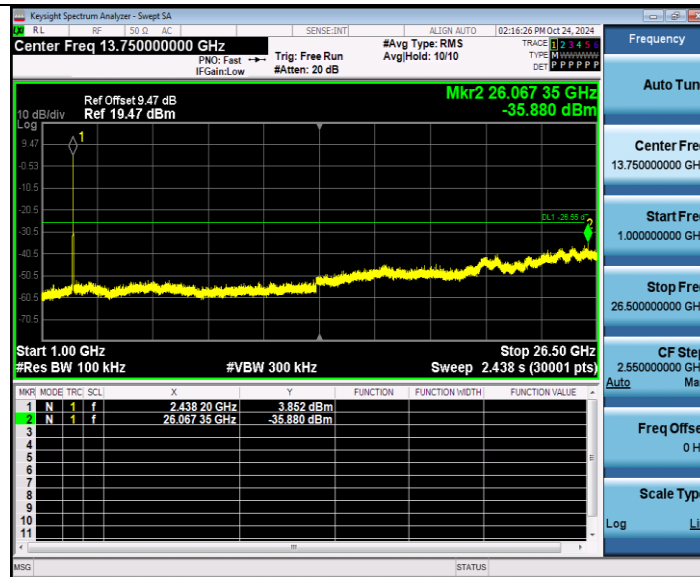

11G Ant W1 2437 0~Reference




11G Ant W1 2437 30~1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

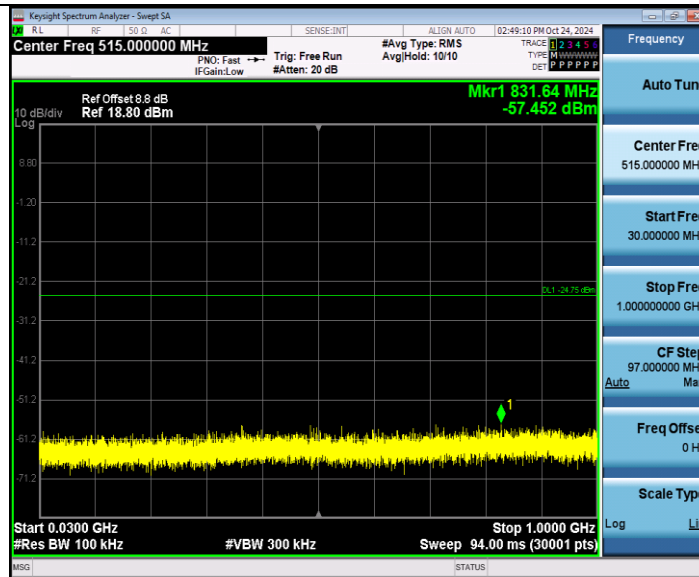

11G_Ant W1_2437_1000~26500

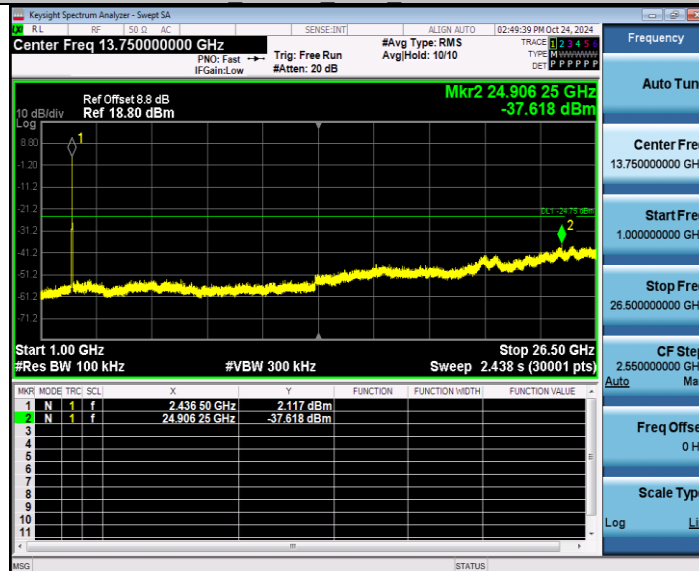

11G_Ant W0_2462_0~Reference




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11G_Ant W0_2462_30~1000

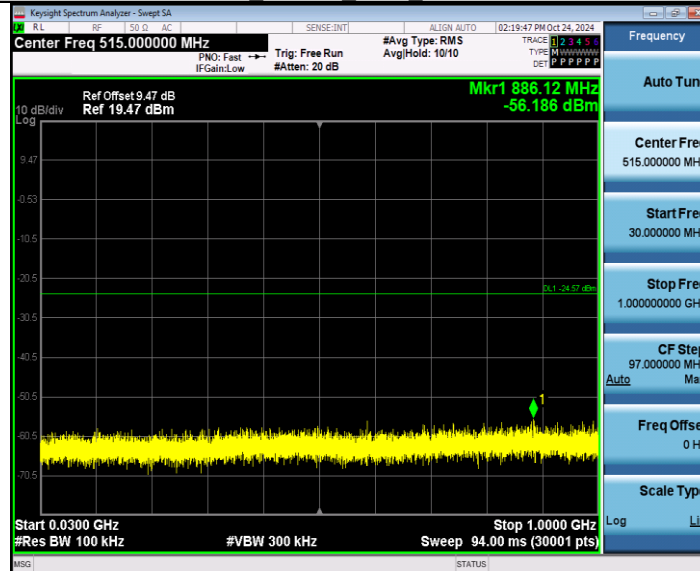


11G_Ant W0_2462_1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

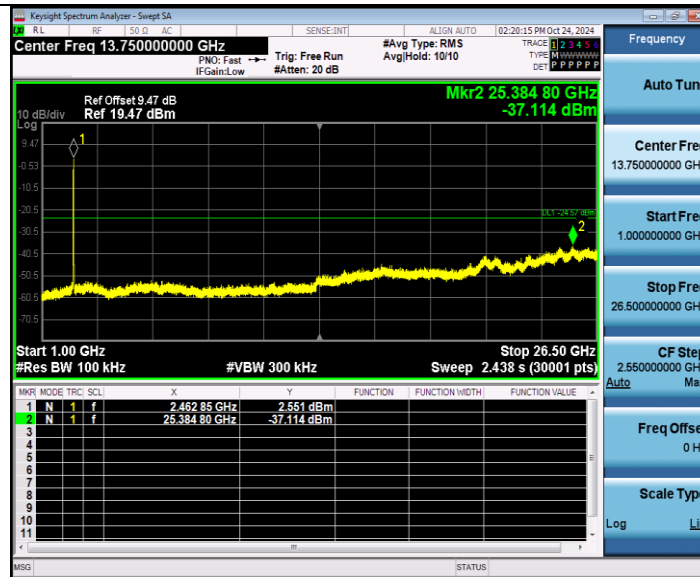

11G Ant W1 2462 0~Reference




11G Ant W1 2462 30~1000



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

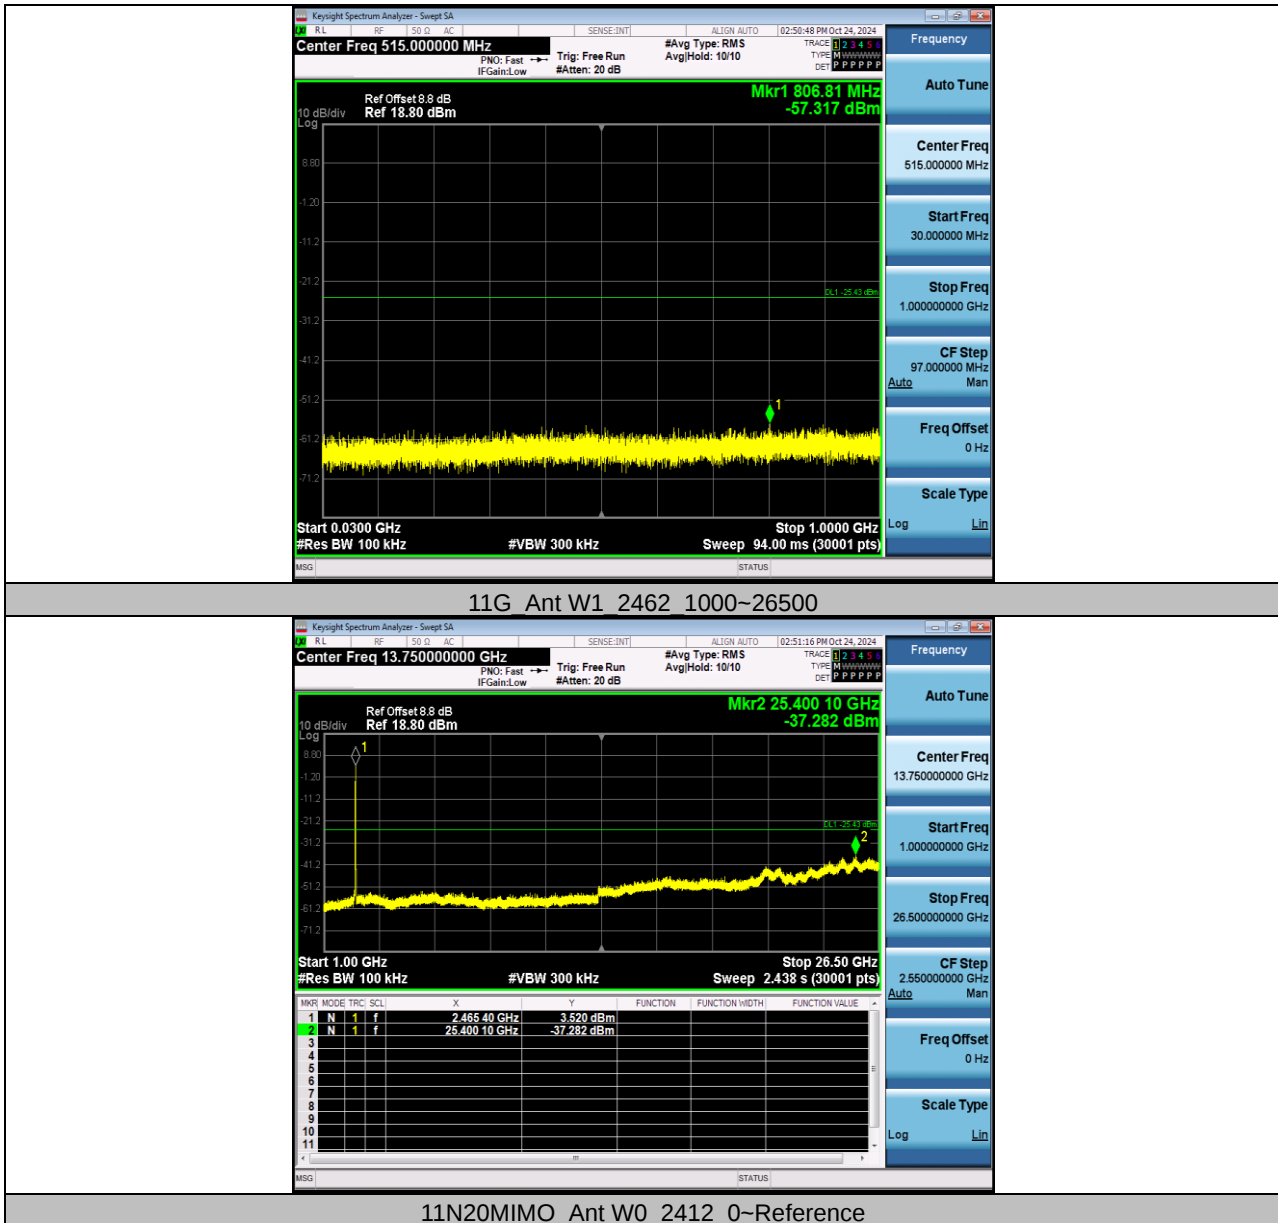




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11N20MIMO Ant W0 2412 30~1000

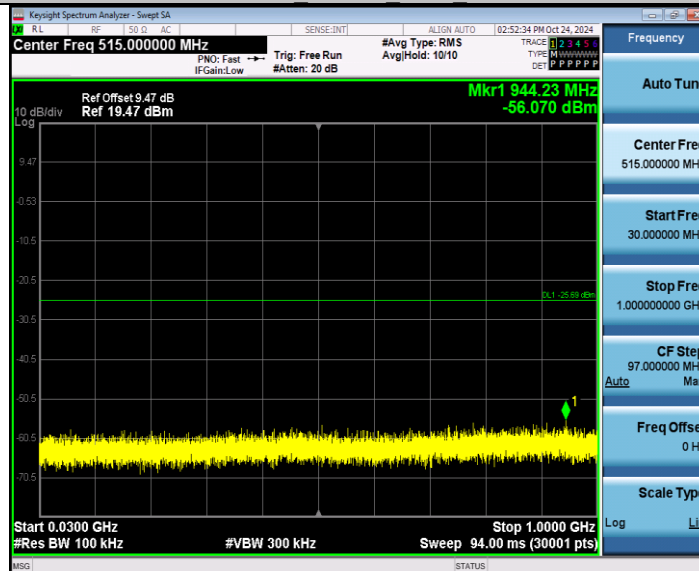


11N20MIMO Ant W0 2412 1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

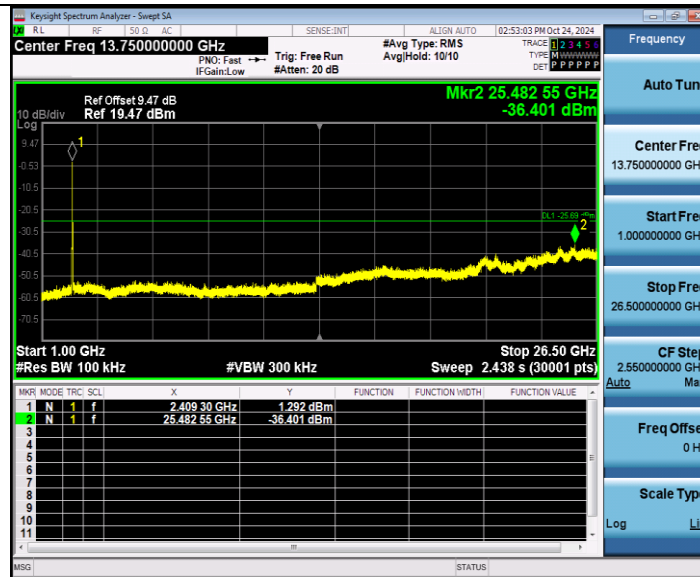

11N20MIMO Ant W1 2412 0-Reference




11N20MIMO Ant W1 2412 30-1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

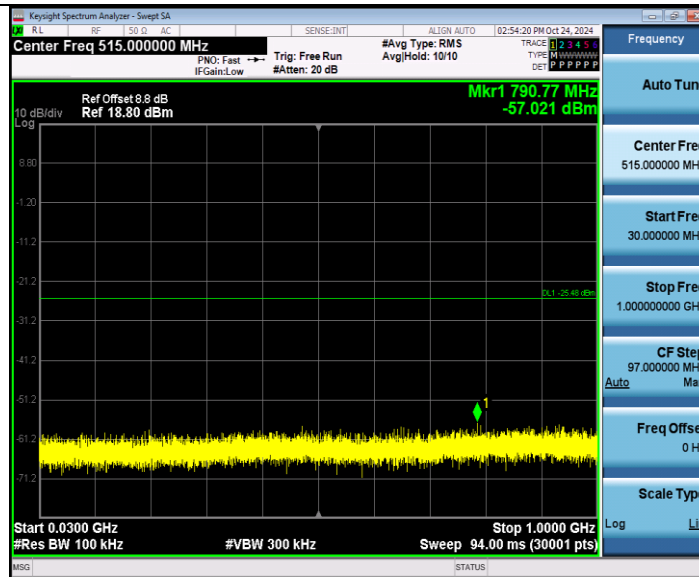

11N20MIMO_Ant W1 2412 1000~26500

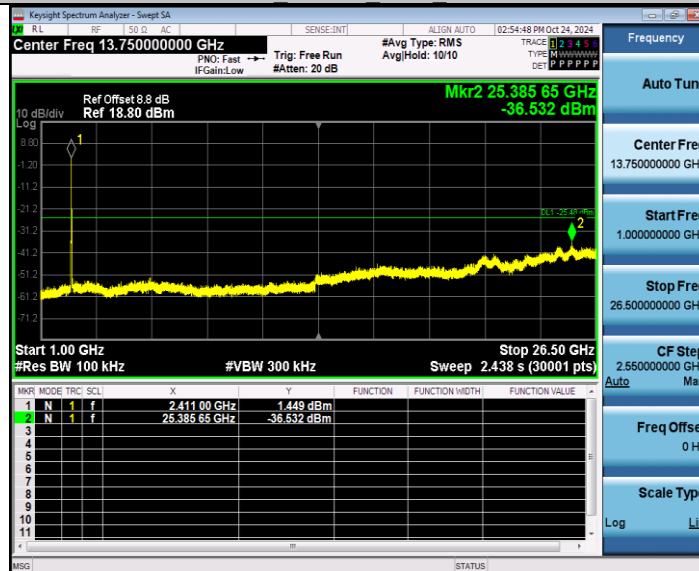

11N20MIMO_Ant W0 2437 0~Reference




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02



11N20MIMO_Ant W0_2437_30~1000

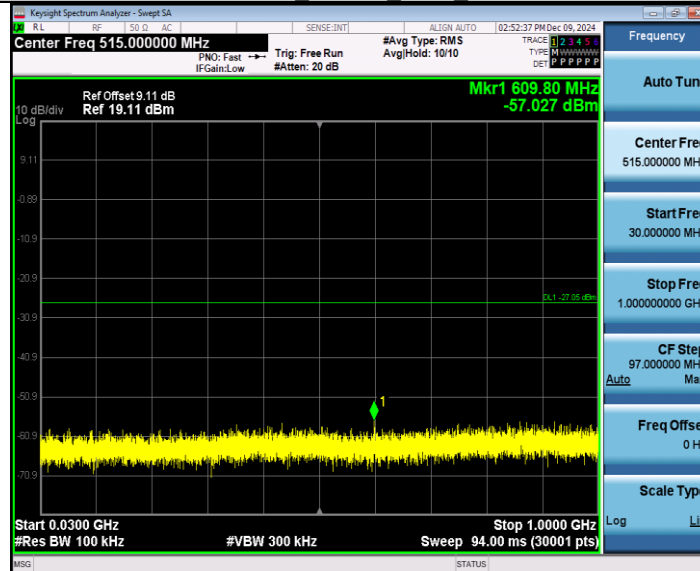


11N20MIMO_Ant W0_2437_1000~26500



BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

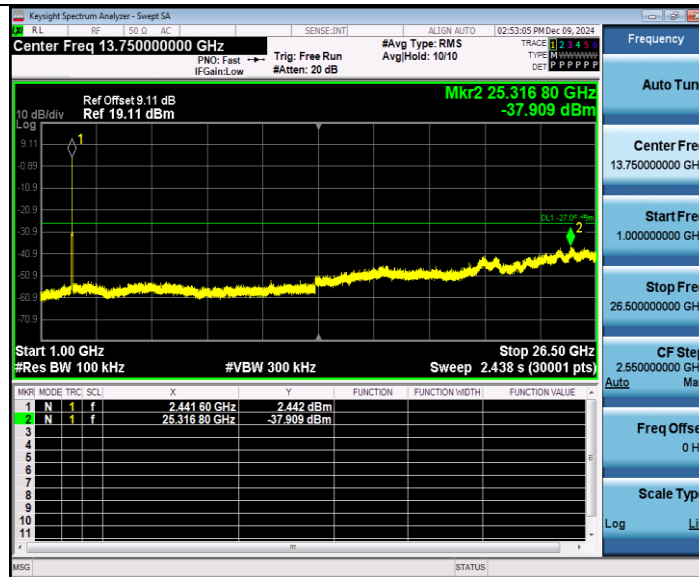

11N20MIMO Ant W1 2437 0-Reference




11N20MIMO Ant W1 2437 30-1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

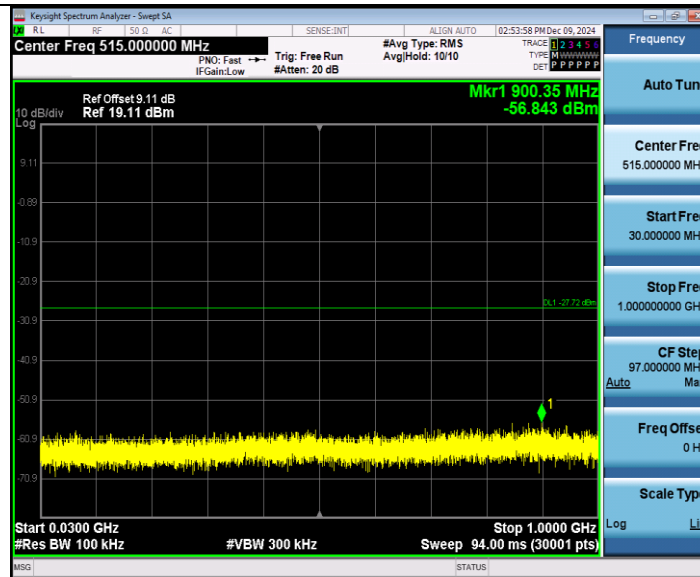

11N20MIMO_Ant W1 2437 1000~26500

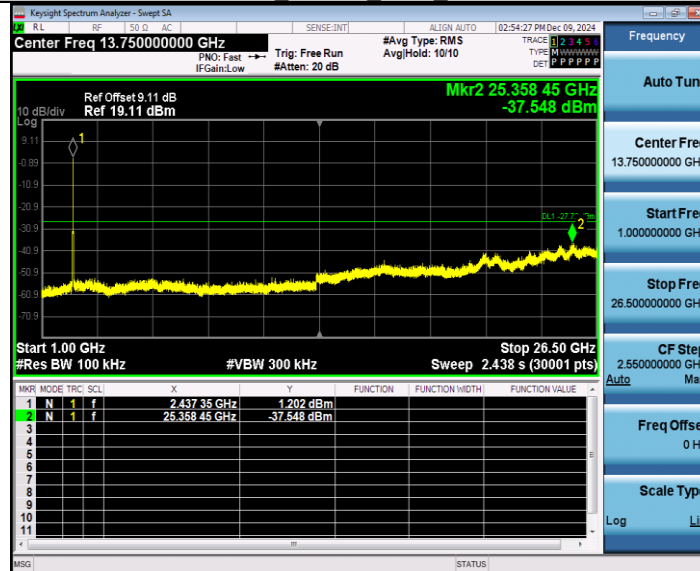

11N20MIMO_Ant W0 2462 0~Reference




Reference No.: W7L-P24090006RF02





BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

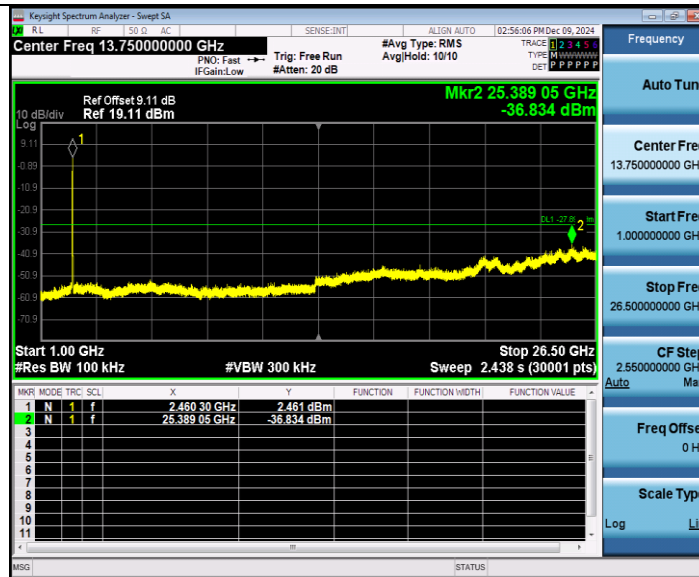

11N20MIMO Ant W1 2462 0~Reference




11N20MIMO Ant W1 2462 30~1000




BUREAU
VERITAS

Reference No.: W7L-P24090006RF02

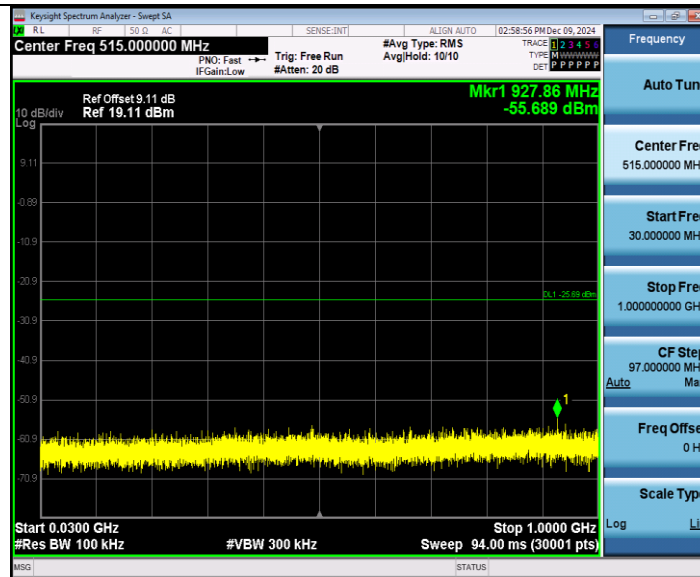

11N20MIMO_Ant W1 2462 1000~26500

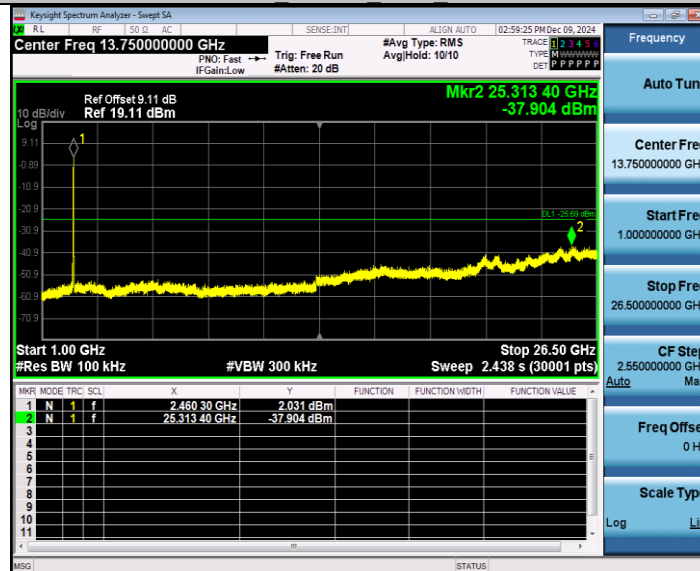

11N40MIMO_Ant W0 2422 0~Reference