





Restrict Band NVNT ac20 5500MHz Ant7 Peak

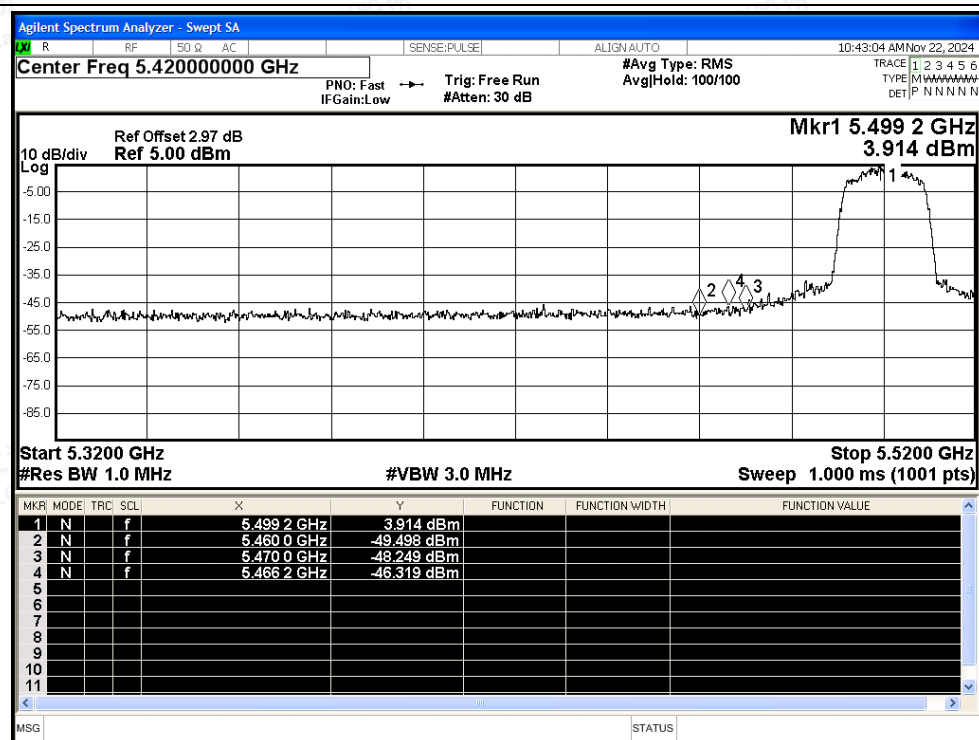

Restrict Band NVNT ac20 5500MHz Ant7 Average

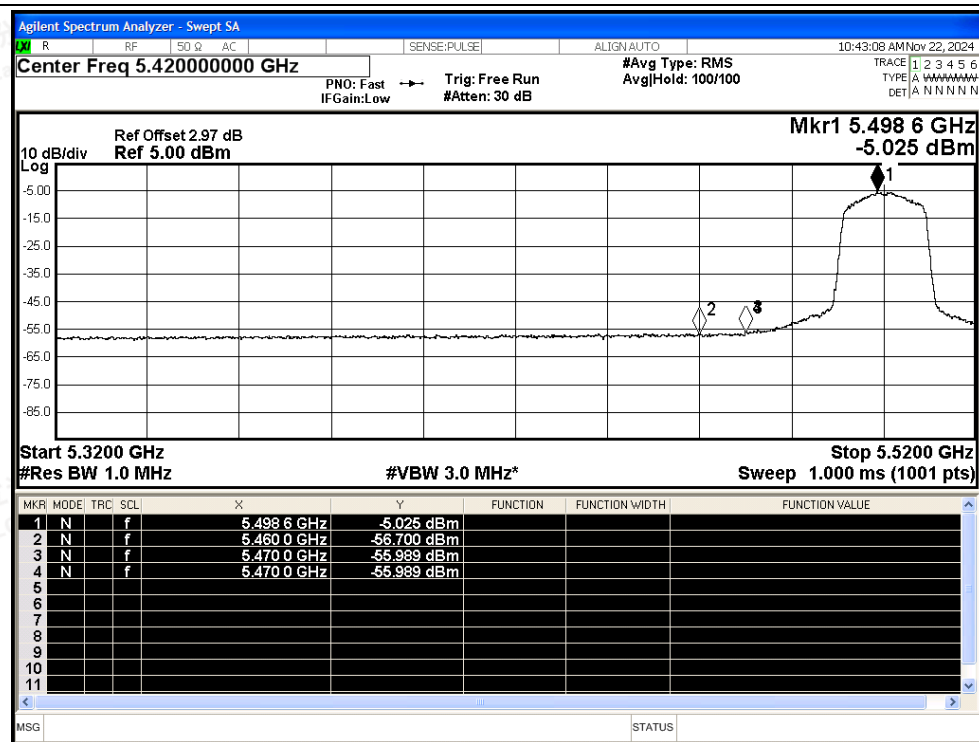

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac20 5700MHz Ant7 Peak

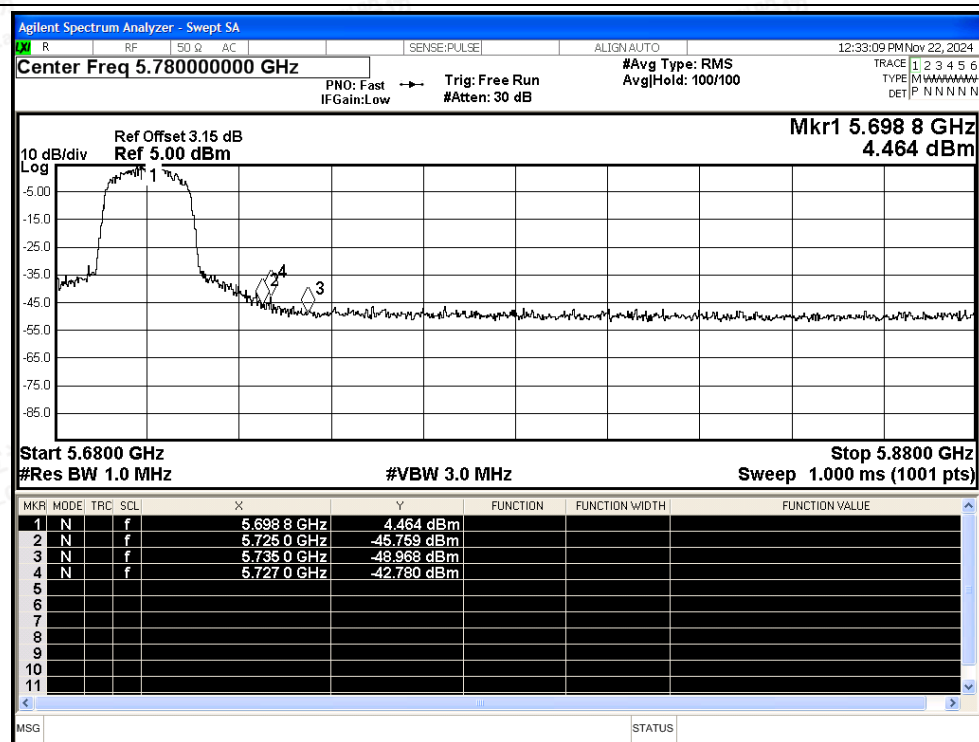

Restrict Band NVNT ac20 5700MHz Ant7 Average

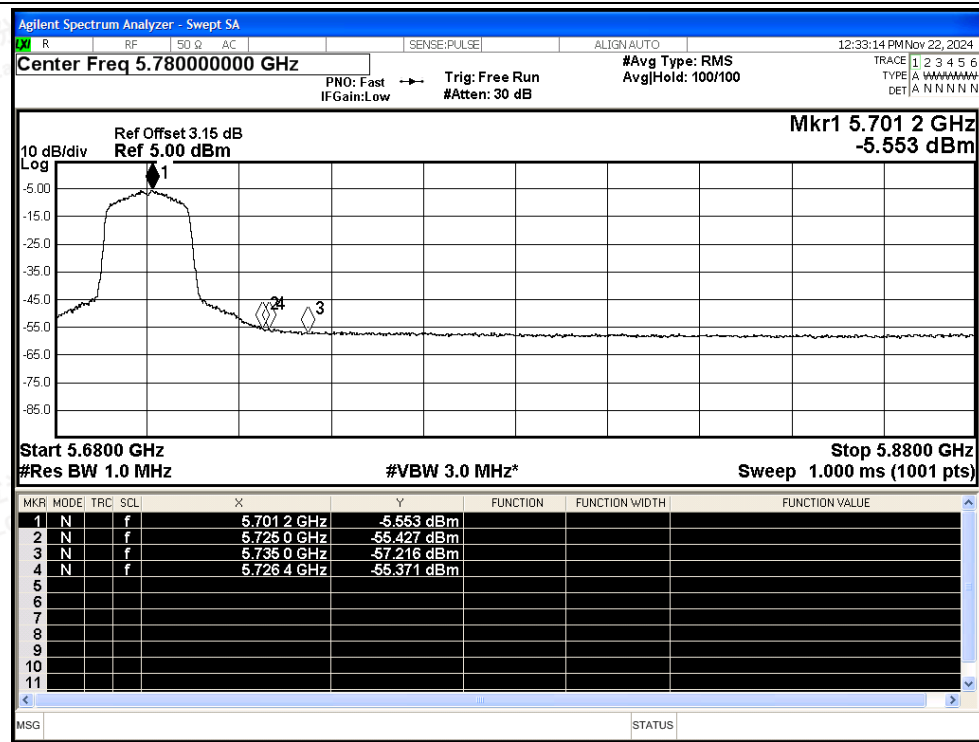

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5510MHz Ant7 Peak

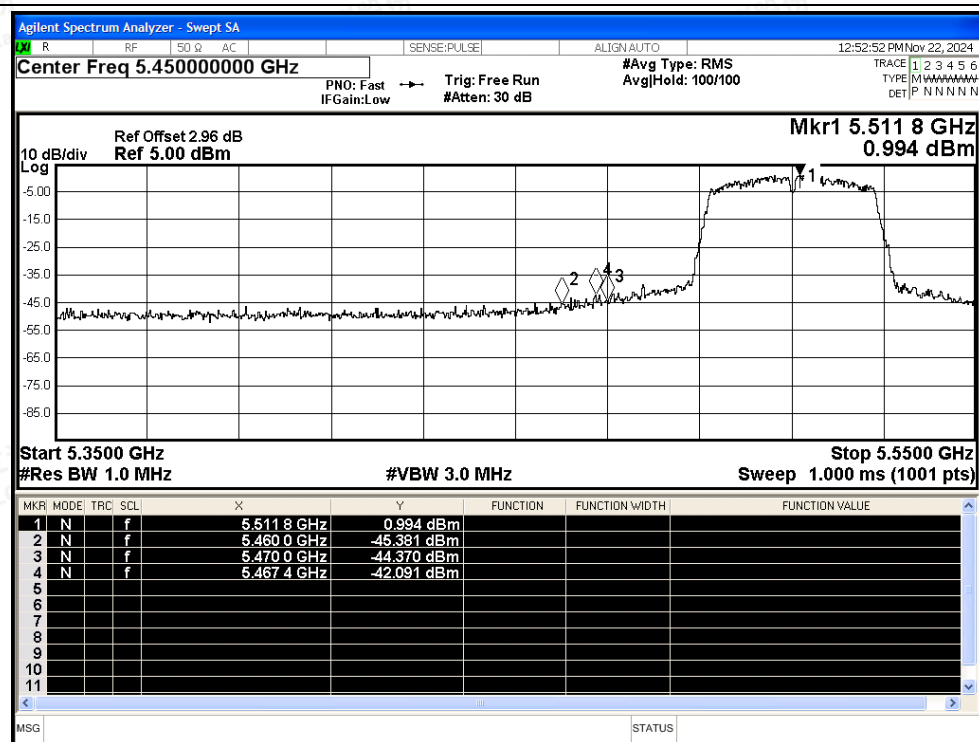

Restrict Band NVNT ac40 5510MHz Ant7 Average

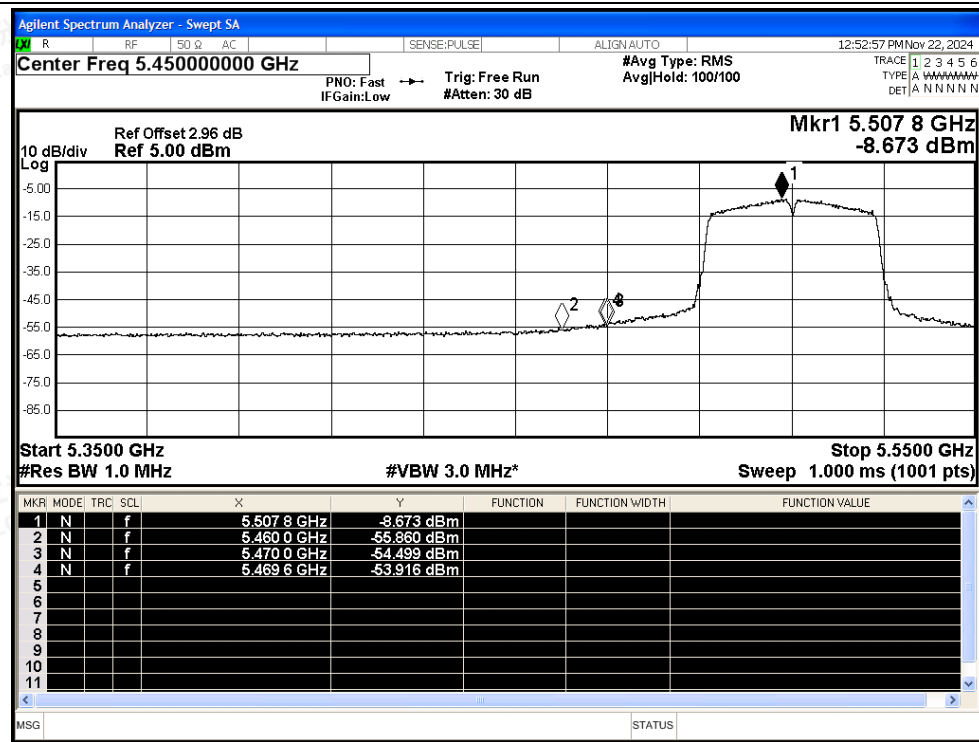

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac40 5670MHz Ant7 Peak

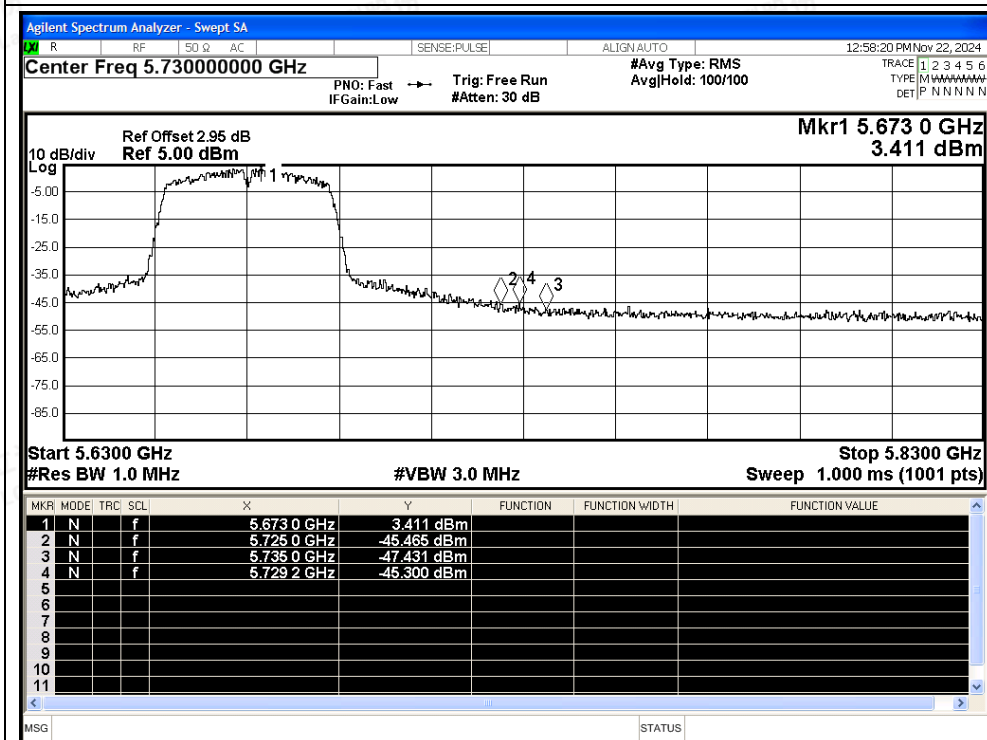

Restrict Band NVNT ac40 5670MHz Ant7 Average

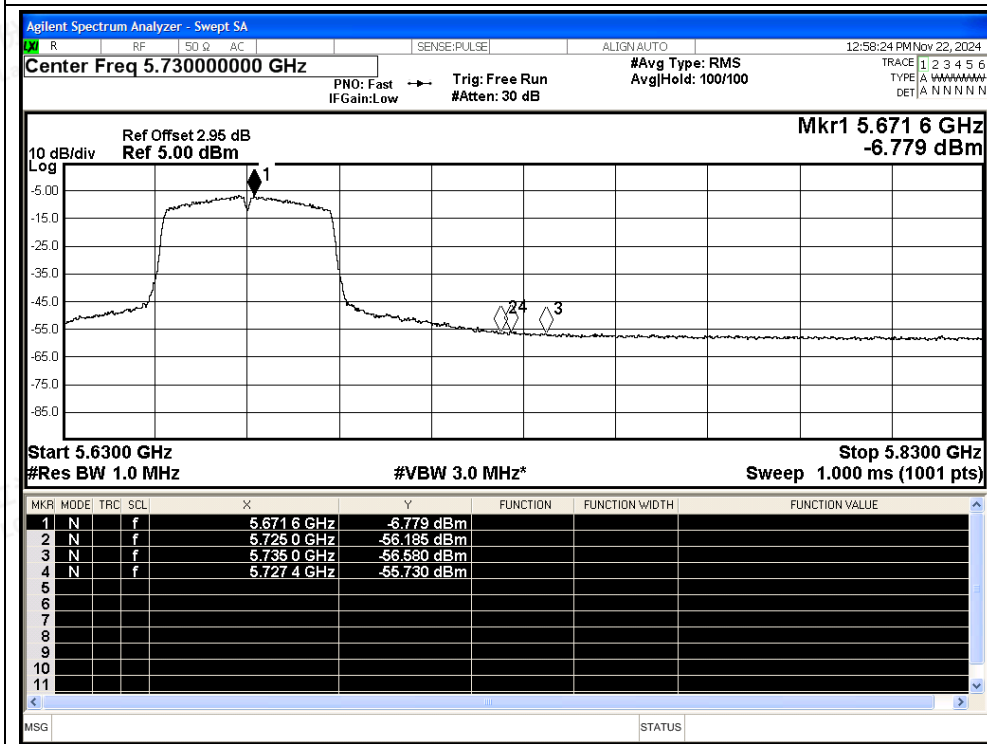

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5530MHz Ant7 Peak

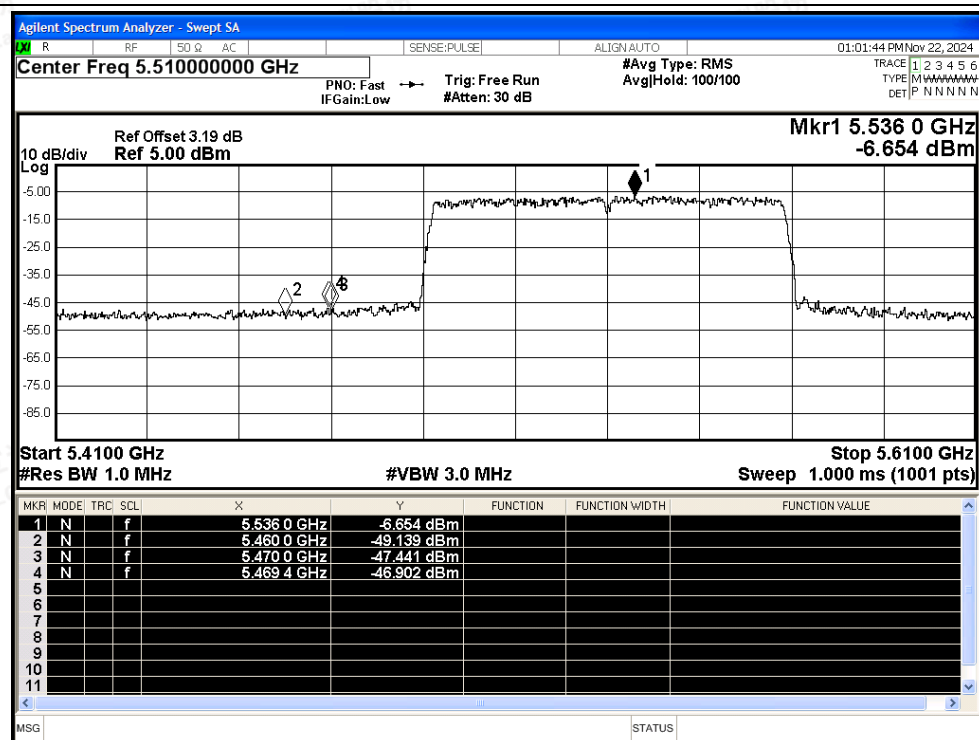

Restrict Band NVNT ac80 5530MHz Ant7 Average

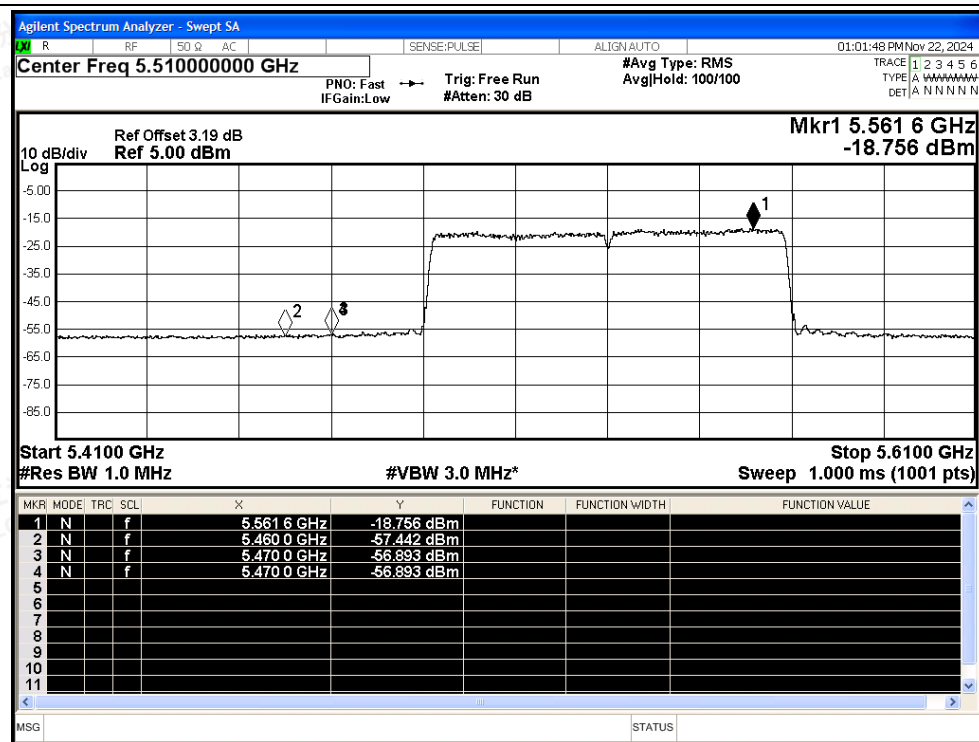

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ac80 5610MHz Ant7 Peak

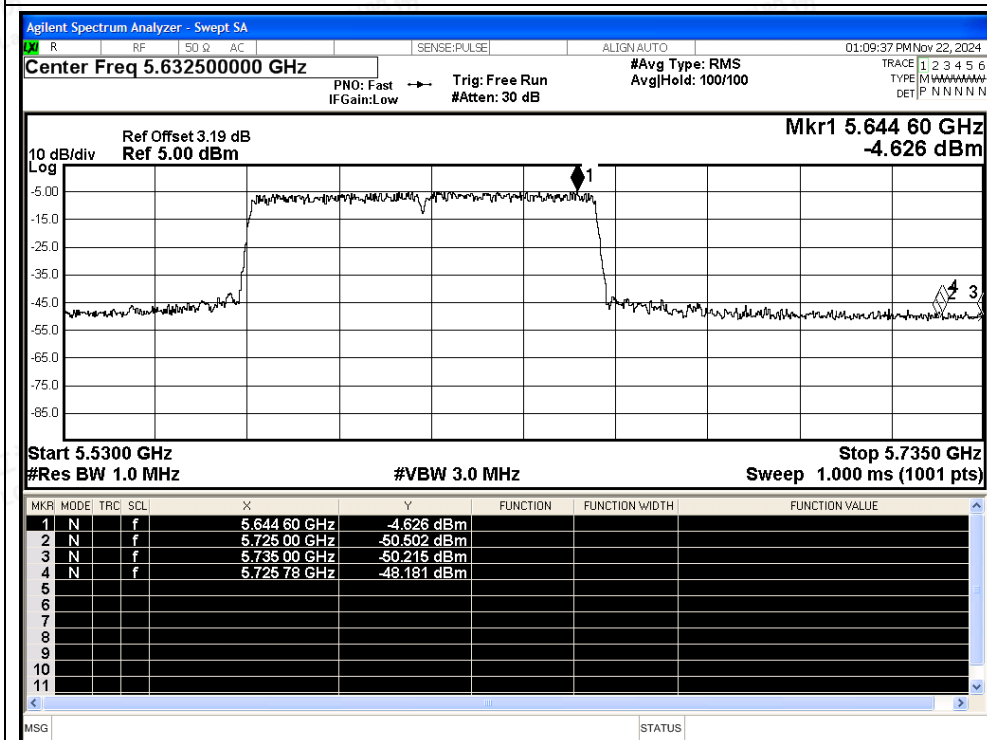

Restrict Band NVNT ac80 5610MHz Ant7 Average

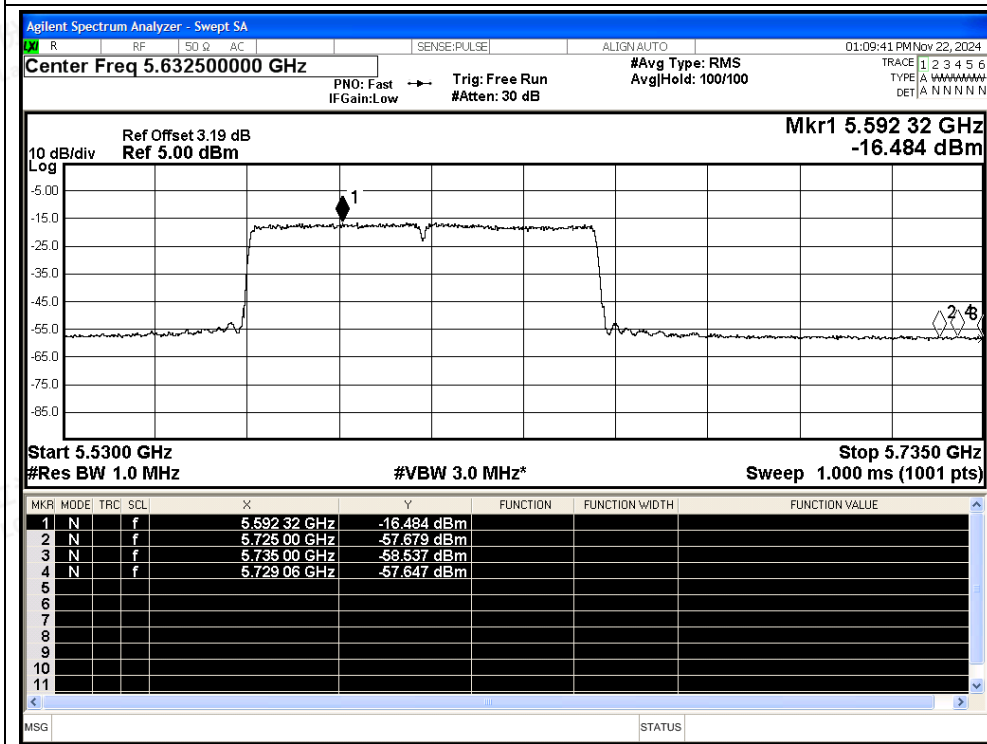

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5500MHz Ant7 Peak

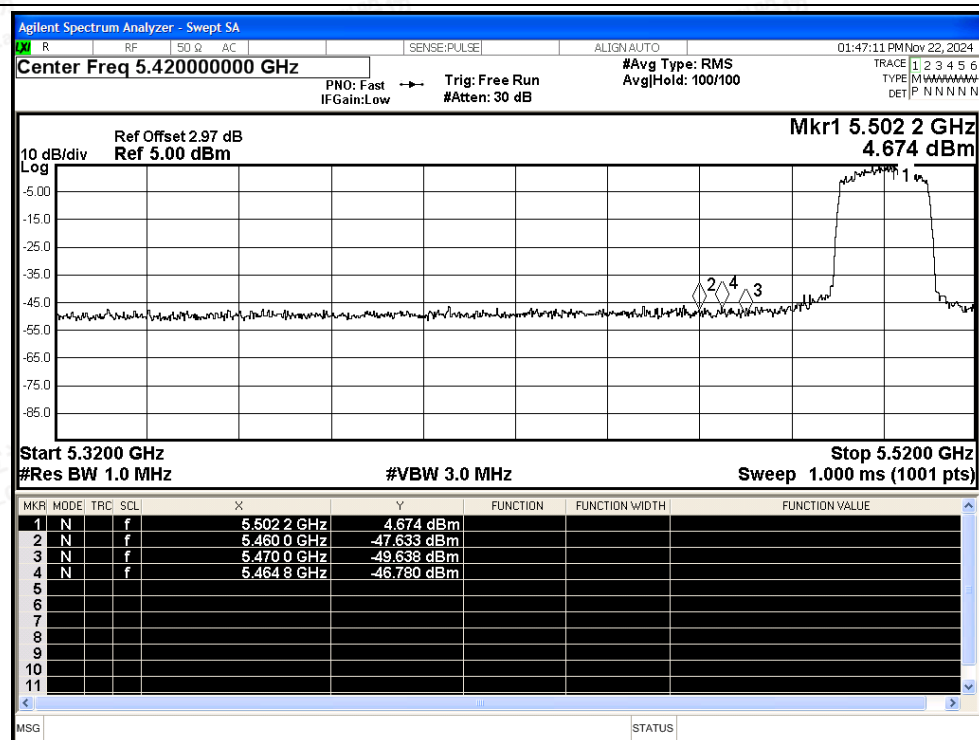

Restrict Band NVNT ax20 5500MHz Ant7 Average

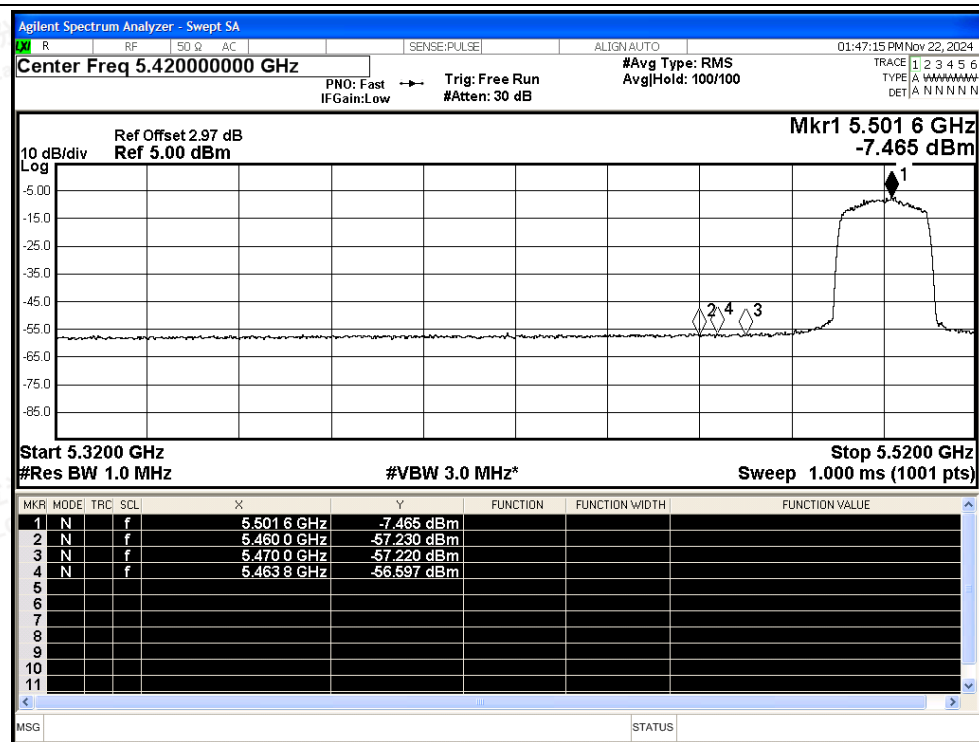

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax20 5700MHz Ant7 Peak

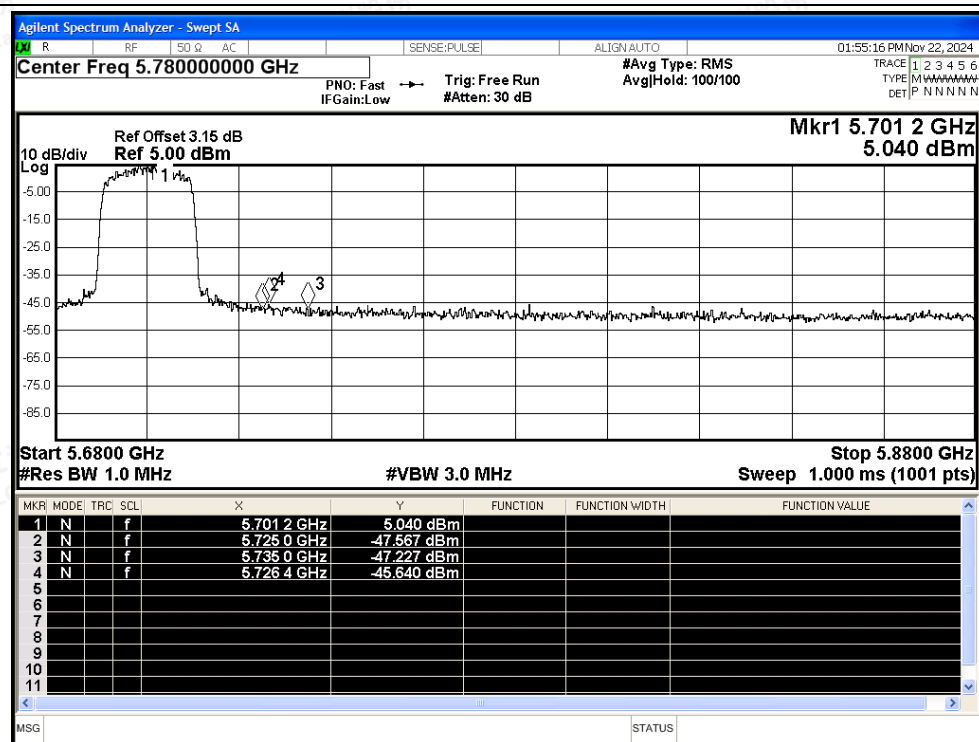

Restrict Band NVNT ax20 5700MHz Ant7 Average

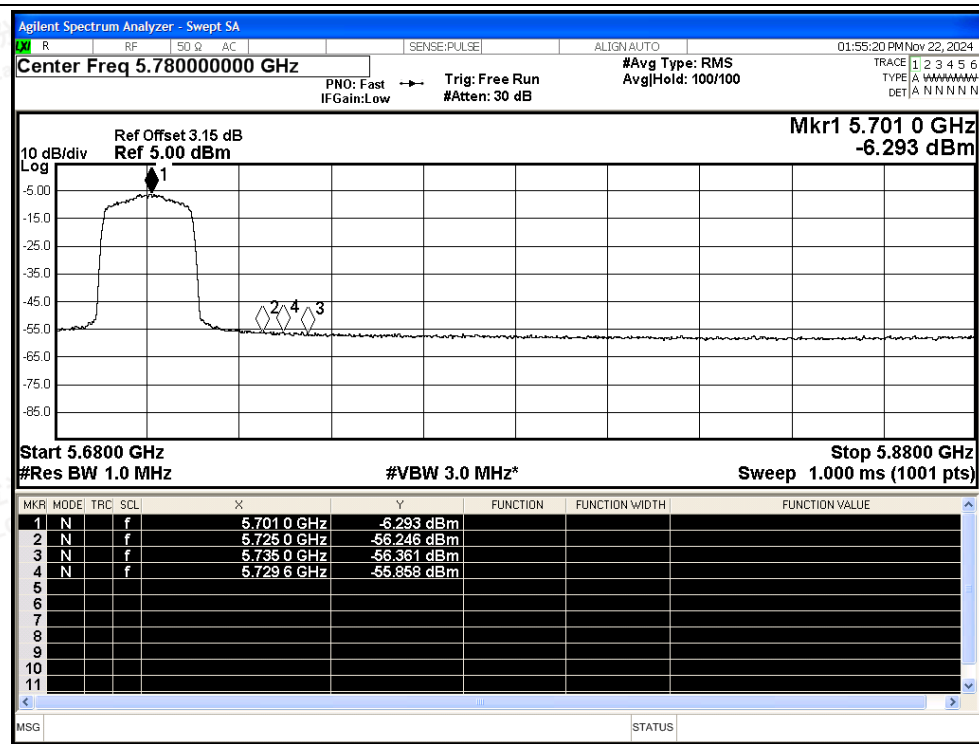

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5510MHz Ant7 Peak

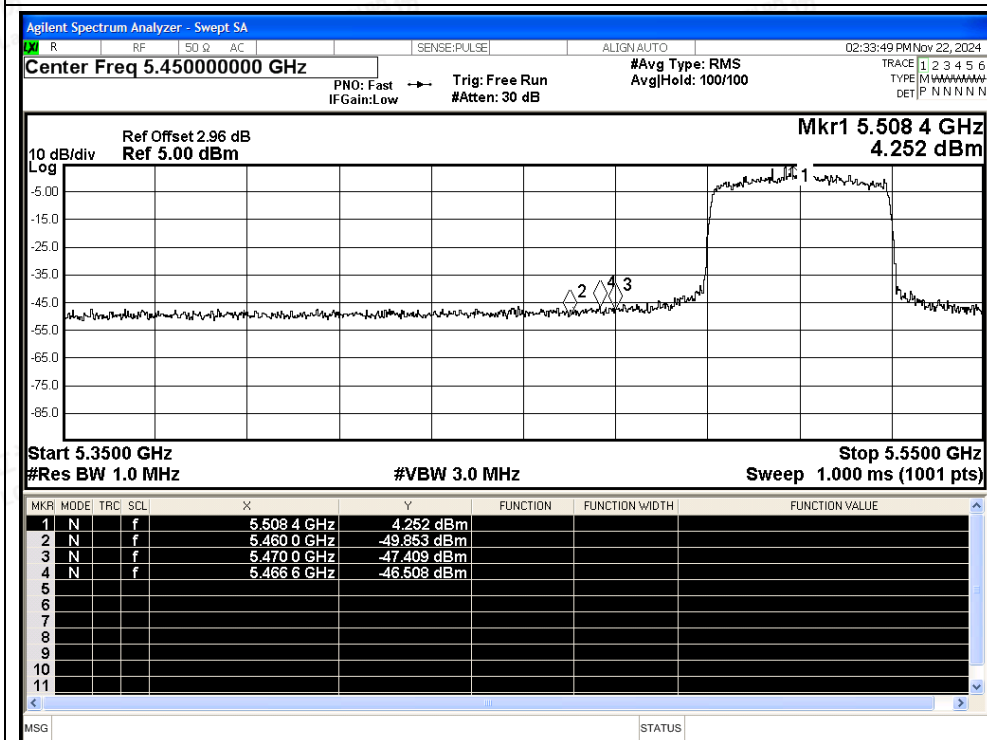

Restrict Band NVNT ax40 5510MHz Ant7 Average

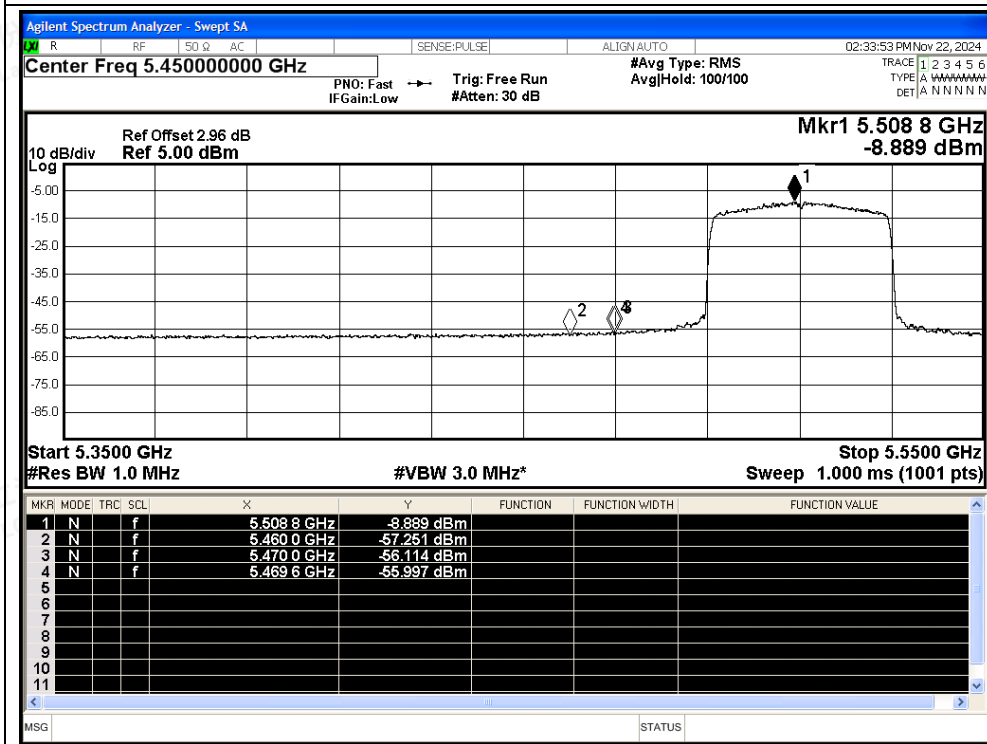

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax40 5670MHz Ant7 Peak

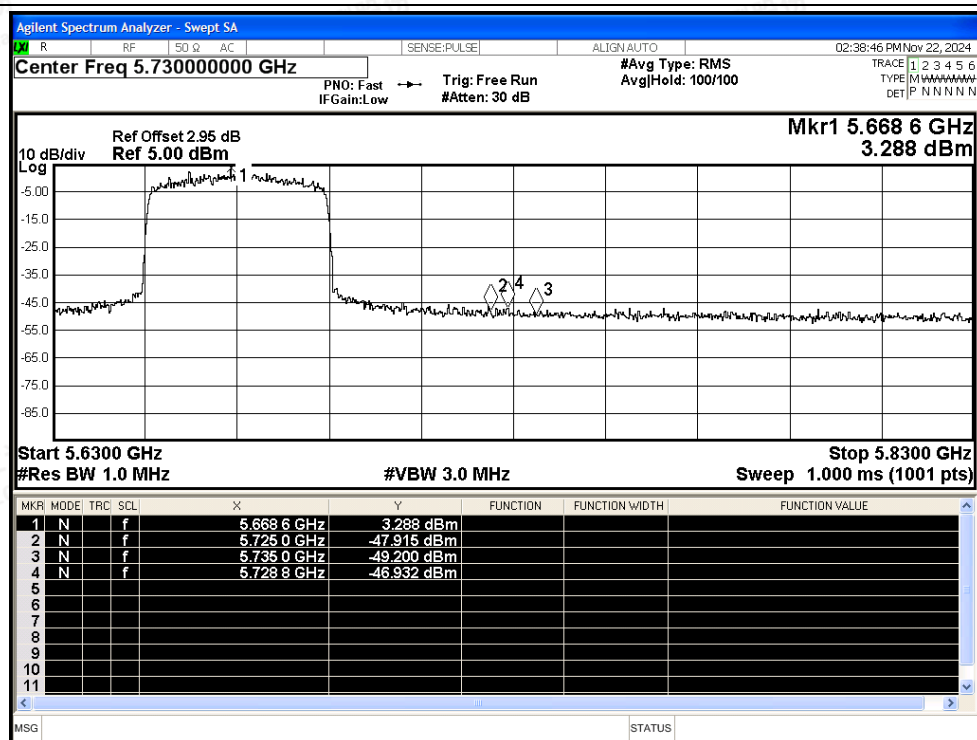

Restrict Band NVNT ax40 5670MHz Ant7 Average

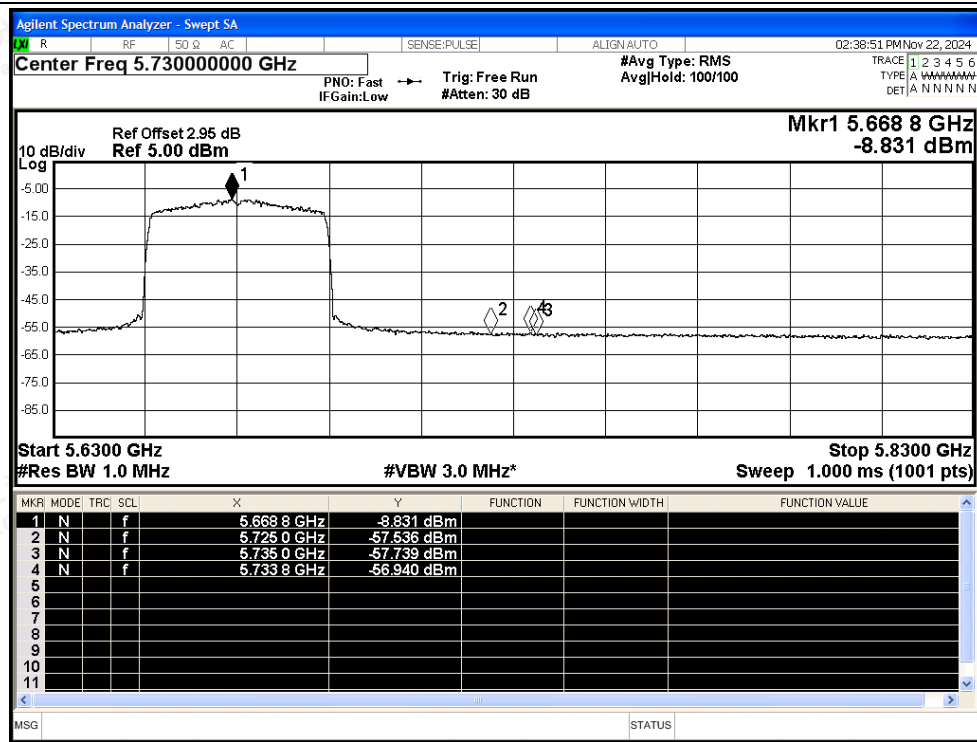

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5530MHz Ant7 Peak

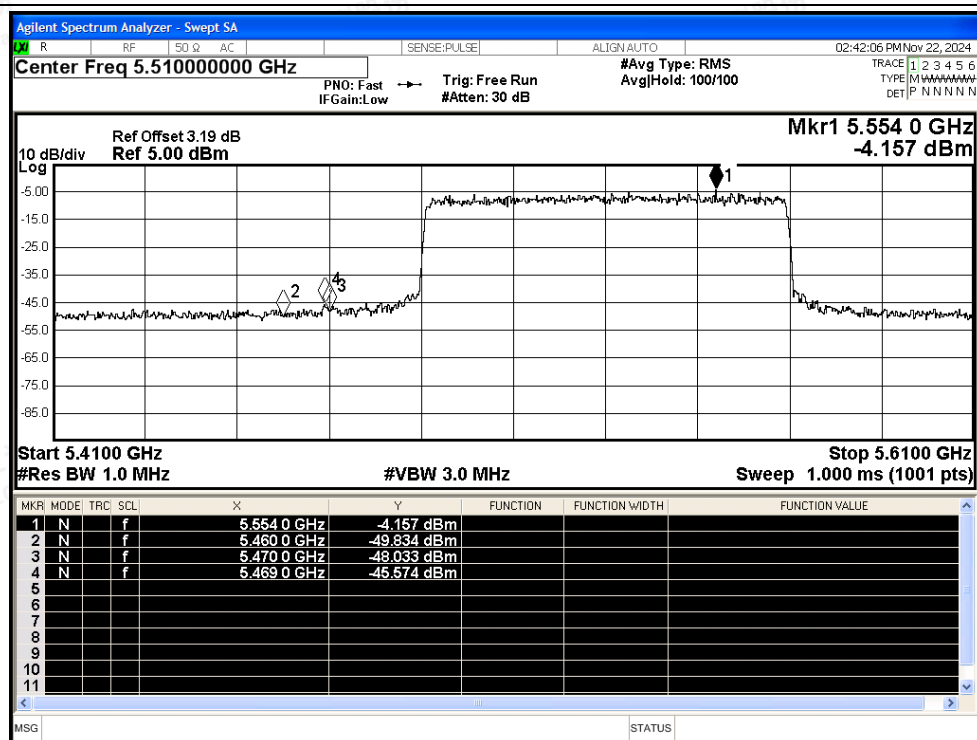

Restrict Band NVNT ax80 5530MHz Ant7 Average

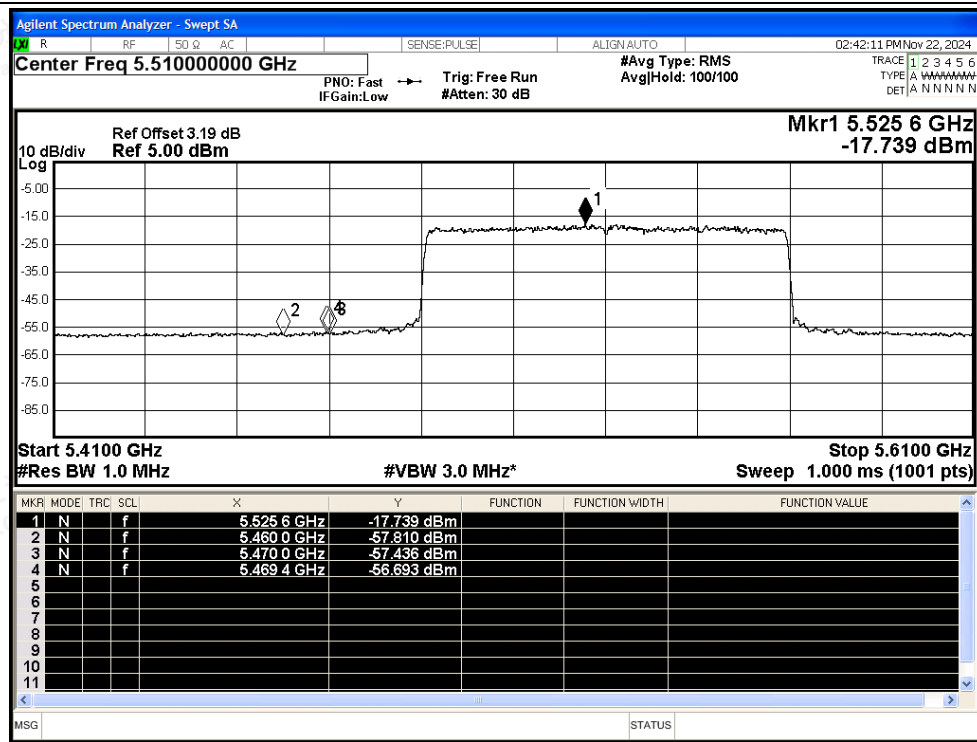

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Restrict Band NVNT ax80 5610MHz Ant7 Peak

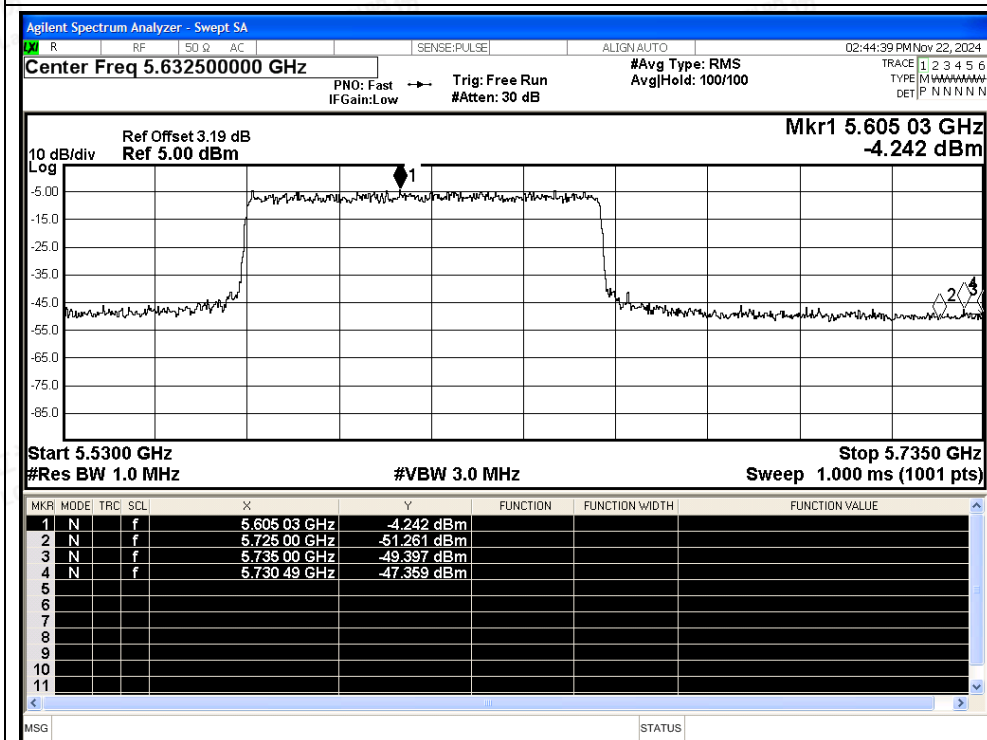

Restrict Band NVNT ax80 5610MHz Ant7 Average

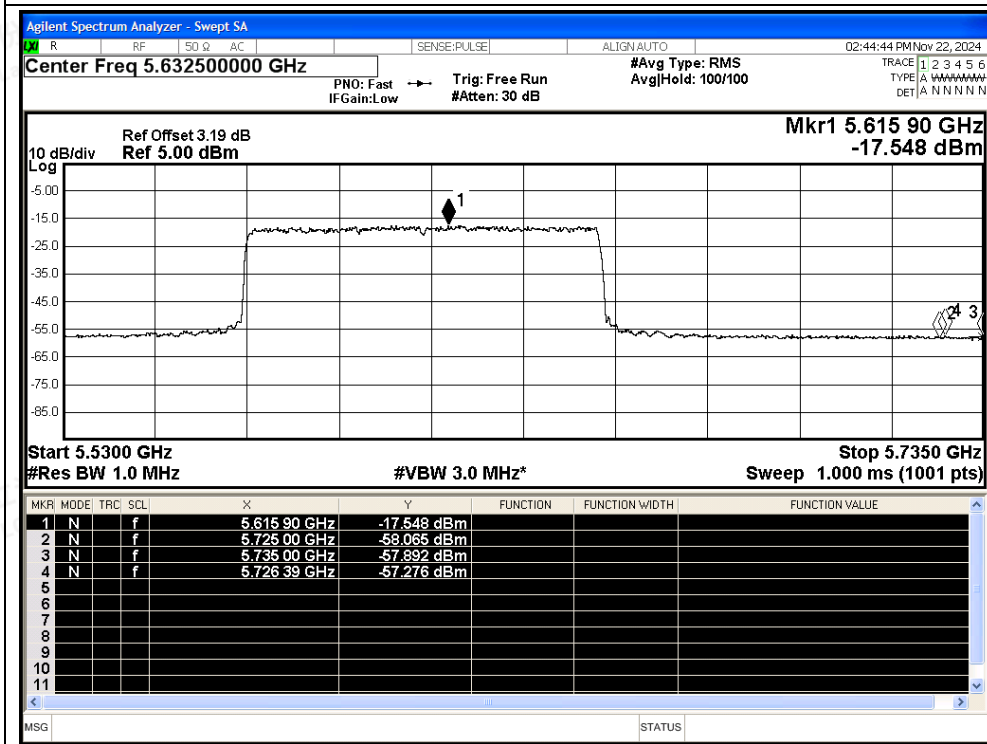

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



MIMO

Condition	Mode	Frequency (MHz)	Spur Freq (MHz)	ANT6 Power (dBm)	ANT7 Power (dBm)	Gain (dBi)	E (dBuV/m)	Detector	Limit (dBuV/m)	Verdict
NVNT	n20	5500	5460	-49.29	-49.53	2.0	50.82	Peak	68.2	Pass
NVNT	n20	5500	5460	-57.67	-57.23	2.0	42.79	Average	54	Pass
NVNT	n20	5500	5467.8	-45.1	-44.21	2.0	55.60	Peak	68.2	Pass
NVNT	n20	5500	5469.2	-56.06	-56.38	2.0	44.02	Average	54	Pass
NVNT	n20	5500	5470	-47.11	-48.07	2.0	52.67	Peak	68.2	Pass
NVNT	n20	5500	5470	-56.42	-56.95	2.0	43.56	Average	54	Pass
NVNT	n20	5700	5725	-45.84	-43.67	2.0	55.61	Peak	68.2	Pass
NVNT	n20	5700	5725	-54.92	-52.99	2.0	46.38	Average	54	Pass
NVNT	n20	5700	5725.2	-44.07	-41.75	2.0	57.48	Peak	68.2	Pass
NVNT	n20	5700	5725	-54.92	-52.49	2.0	46.70	Average	54	Pass
NVNT	n20	5700	5735	-49.53	-49.18	2.0	50.88	Peak	68.2	Pass
NVNT	n20	5700	5735	-56.73	-56.45	2.0	43.65	Average	54	Pass
NVNT	n40	5510	5460	-49.75	-45.91	2.0	52.81	Peak	68.2	Pass
NVNT	n40	5510	5460	-57.64	-55.44	2.0	43.83	Average	54	Pass
NVNT	n40	5510	5468.6	-43.29	-41.39	2.0	58.00	Peak	68.2	Pass
NVNT	n40	5510	5467.4	-56.74	-53.49	2.0	45.42	Average	54	Pass
NVNT	n40	5510	5470	-48.51	-44.88	2.0	53.91	Peak	68.2	Pass
NVNT	n40	5510	5470	-57.29	-53.79	2.0	45.04	Average	54	Pass
NVNT	n40	5670	5725	-48.88	-46.97	2.0	52.41	Peak	68.2	Pass
NVNT	n40	5670	5725	-57.15	-55.97	2.0	43.71	Average	54	Pass
NVNT	n40	5670	5725.6	-46.22	-45.45	2.0	54.42	Peak	68.2	Pass
NVNT	n40	5670	5728.4	-56.55	-54.84	2.0	44.62	Average	54	Pass
NVNT	n40	5670	5735	-49.35	-48.95	2.0	51.09	Peak	68.2	Pass
NVNT	n40	5670	5735	-57.78	-57.16	2.0	42.77	Average	54	Pass
NVNT	ac20	5500	5460	-50.26	-49.5	2.0	50.37	Peak	68.2	Pass
NVNT	ac20	5500	5460	-57.92	-56.7	2.0	42.97	Average	54	Pass
NVNT	ac20	5500	5470	-46.18	-46.32	2.0	53.98	Peak	68.2	Pass
NVNT	ac20	5500	5464	-56.74	-55.99	2.0	43.88	Average	54	Pass
NVNT	ac20	5500	5470	-46.18	-48.25	2.0	53.14	Peak	68.2	Pass
NVNT	ac20	5500	5470	-57.15	-55.99	2.0	43.70	Average	54	Pass
NVNT	ac20	5700	5725	-48.43	-45.76	2.0	53.34	Peak	68.2	Pass
NVNT	ac20	5700	5725	-56.79	-55.43	2.0	44.18	Average	54	Pass
NVNT	ac20	5700	5734.8	-47.29	-42.78	2.0	55.76	Peak	68.2	Pass
NVNT	ac20	5700	5725	-56.79	-55.37	2.0	44.21	Average	54	Pass
NVNT	ac20	5700	5735	-50.29	-48.97	2.0	50.65	Peak	68.2	Pass
NVNT	ac20	5700	5735	-57.71	-57.22	2.0	42.78	Average	54	Pass
NVNT	ac40	5510	5460	-49.82	-45.38	2.0	53.18	Peak	68.2	Pass
NVNT	ac40	5510	5460	-57.37	-55.86	2.0	43.68	Average	54	Pass
NVNT	ac40	5510	5460.2	-40.41	-42.09	2.0	59.06	Peak	68.2	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ac40	5510	5466.4	-56.61	-53.92	2.0	45.17	Average	54	Pass
NVNT	ac40	5510	5470	-48.49	-44.37	2.0	54.27	Peak	68.2	Pass
NVNT	ac40	5510	5470	-56.81	-54.5	2.0	44.73	Average	54	Pass
NVNT	ac40	5670	5725	-49.87	-45.47	2.0	53.10	Peak	68.2	Pass
NVNT	ac40	5670	5725	-58.18	-56.19	2.0	43.16	Average	54	Pass
NVNT	ac40	5670	5732.4	-46.77	-45.3	2.0	54.26	Peak	68.2	Pass
NVNT	ac40	5670	5726.8	-57.27	-55.73	2.0	43.80	Average	54	Pass
NVNT	ac40	5670	5735	-49.01	-47.43	2.0	52.08	Peak	68.2	Pass
NVNT	ac40	5670	5735	-58.16	-56.58	2.0	42.93	Average	54	Pass
NVNT	ac80	5530	5460	-49.42	-49.14	2.0	50.96	Peak	68.2	Pass
NVNT	ac80	5530	5460	-57.6	-57.44	2.0	42.71	Average	54	Pass
NVNT	ac80	5530	5467.2	-46.1	-46.9	2.0	53.75	Peak	68.2	Pass
NVNT	ac80	5530	5469.6	-55.66	-56.89	2.0	44.00	Average	54	Pass
NVNT	ac80	5530	5470	-49.86	-47.44	2.0	51.75	Peak	68.2	Pass
NVNT	ac80	5530	5470	-56.44	-56.89	2.0	43.57	Average	54	Pass
NVNT	ac80	5610	5725	-49.43	-50.5	2.0	50.30	Peak	68.2	Pass
NVNT	ac80	5610	5725	-58.52	-57.68	2.0	42.15	Average	54	Pass
NVNT	ac80	5610	5729.465	-47.36	-48.18	2.0	52.48	Peak	68.2	Pass
NVNT	ac80	5610	5734.795	-57.52	-57.65	2.0	42.65	Average	54	Pass
NVNT	ac80	5610	5735	-49.18	-50.22	2.0	50.56	Peak	68.2	Pass
NVNT	ac80	5610	5735	-57.96	-58.54	2.0	41.99	Average	54	Pass
NVNT	ax20	5500	5460	-48.75	-47.63	2.0	52.08	Peak	68.2	Pass
NVNT	ax20	5500	5460	-57.07	-57.23	2.0	43.08	Average	54	Pass
NVNT	ax20	5500	5461.2	-44.82	-46.78	2.0	54.54	Peak	68.2	Pass
NVNT	ax20	5500	5463.6	-56.32	-56.6	2.0	43.78	Average	54	Pass
NVNT	ax20	5500	5470	-47.11	-49.64	2.0	52.04	Peak	68.2	Pass
NVNT	ax20	5500	5470	-57.14	-57.22	2.0	43.05	Average	54	Pass
NVNT	ax20	5700	5725	-46.12	-47.57	2.0	53.45	Peak	68.2	Pass
NVNT	ax20	5700	5725	-55.83	-56.25	2.0	44.20	Average	54	Pass
NVNT	ax20	5700	5727	-45.25	-45.64	2.0	54.79	Peak	68.2	Pass
NVNT	ax20	5700	5731.4	-55.49	-55.86	2.0	44.56	Average	54	Pass
NVNT	ax20	5700	5735	-48.02	-47.23	2.0	52.63	Peak	68.2	Pass
NVNT	ax20	5700	5735	-56.26	-56.36	2.0	43.92	Average	54	Pass
NVNT	ax40	5510	5460	-49.03	-49.85	2.0	50.81	Peak	68.2	Pass
NVNT	ax40	5510	5460	-57.92	-57.25	2.0	42.66	Average	54	Pass
NVNT	ax40	5510	5467.2	-46.7	-46.51	2.0	53.63	Peak	68.2	Pass
NVNT	ax40	5510	5469.2	-56.8	-56	2.0	43.85	Average	54	Pass
NVNT	ax40	5510	5470	-50	-47.41	2.0	51.72	Peak	68.2	Pass
NVNT	ax40	5510	5470	-57.5	-56.11	2.0	43.48	Average	54	Pass
NVNT	ax40	5670	5725	-49.59	-47.92	2.0	51.56	Peak	68.2	Pass
NVNT	ax40	5670	5725	-57.77	-57.54	2.0	42.58	Average	54	Pass
NVNT	ax40	5670	5730.4	-47.92	-46.93	2.0	52.84	Peak	68.2	Pass
NVNT	ax40	5670	5734.4	-57.54	-56.94	2.0	43.00	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



NVNT	ax40	5670	5735	-49.96	-49.2	2.0	50.67	Peak	68.2	Pass
NVNT	ax40	5670	5735	-58.14	-57.74	2.0	42.30	Average	54	Pass
NVNT	ax80	5530	5460	-47.92	-49.83	2.0	51.46	Peak	68.2	Pass
NVNT	ax80	5530	5460	-57.19	-57.81	2.0	42.74	Average	54	Pass
NVNT	ax80	5530	5465.8	-44.63	-45.57	2.0	55.16	Peak	68.2	Pass
NVNT	ax80	5530	5469.6	-55.5	-56.69	2.0	44.18	Average	54	Pass
NVNT	ax80	5530	5470	-46.42	-48.03	2.0	53.08	Peak	68.2	Pass
NVNT	ax80	5530	5470	-56.57	-57.44	2.0	43.25	Average	54	Pass
NVNT	ax80	5610	5725	-48.58	-51.26	2.0	50.52	Peak	68.2	Pass
NVNT	ax80	5610	5725	-57.98	-58.07	2.0	42.21	Average	54	Pass
NVNT	ax80	5610	5729.26	-48.88	-47.36	2.0	52.18	Peak	68.2	Pass
NVNT	ax80	5610	5725.365	-57.78	-57.28	2.0	42.71	Average	54	Pass
NVNT	ax80	5610	5735	-50.79	-49.4	2.0	50.19	Peak	68.2	Pass
NVNT	ax80	5610	5735	-58.09	-57.89	2.0	42.24	Average	54	Pass



Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.5 Frequency Stability


Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant6	5499.98	-20000	-3.64	25	Pass
NVNT	a	5580	Ant6	5580	0	0	25	Pass
NVNT	a	5700	Ant6	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant6	5499.98	-20000	-3.64	25	Pass
NVNT	n20	5580	Ant6	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant6	5700	0	0	25	Pass
NVNT	n40	5510	Ant6	5509.96	-40000	-7.26	25	Pass
NVNT	n40	5550	Ant6	5549.96	-40000	-7.21	25	Pass
NVNT	n40	5670	Ant6	5670	0	0	25	Pass
NVNT	ac20	5500	Ant6	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant6	5579.98	-20000	-3.58	25	Pass
NVNT	ac20	5700	Ant6	5700.14	140000	24.56	25	Pass
NVNT	ac40	5510	Ant6	5510	0	0	25	Pass
NVNT	ac40	5550	Ant6	5550.04	40000	7.21	25	Pass
NVNT	ac40	5670	Ant6	5670	0	0	25	Pass
NVNT	ac80	5530	Ant6	5530	0	0	25	Pass
NVNT	ac80	5610	Ant6	5610	0	0	25	Pass
NVNT	ax20	5500	Ant6	5500	0	0	25	Pass
NVNT	ax20	5580	Ant6	5579.98	-20000	-3.58	25	Pass
NVNT	ax20	5700	Ant6	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant6	5510.04	40000	7.26	25	Pass
NVNT	ax40	5550	Ant6	5549.96	-40000	-7.21	25	Pass
NVNT	ax40	5670	Ant6	5670	0	0	25	Pass
NVNT	ax80	5530	Ant6	5530	0	0	25	Pass
NVNT	ax80	5610	Ant6	5610	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5500MHz Ant6

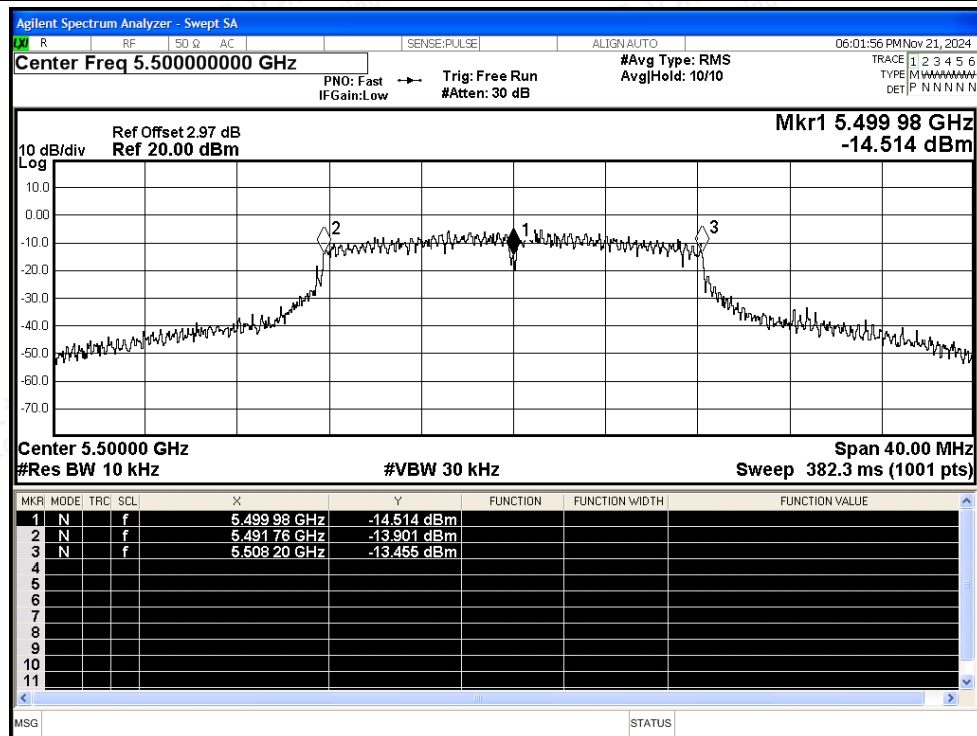

Freq. Stability NVNT a 5580MHz Ant6

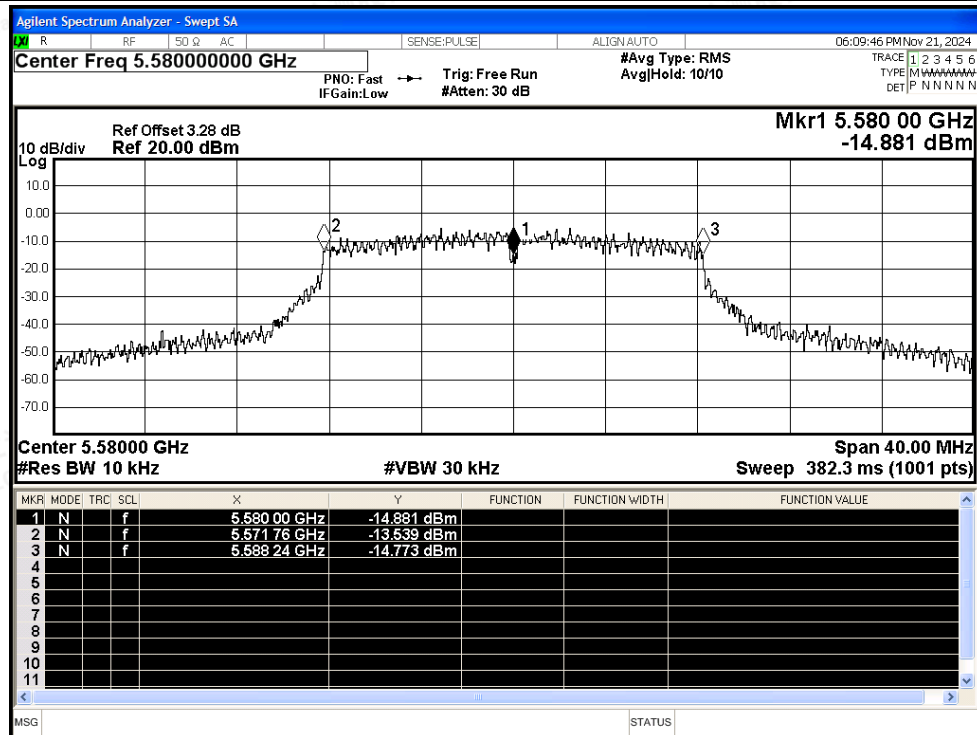

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant6

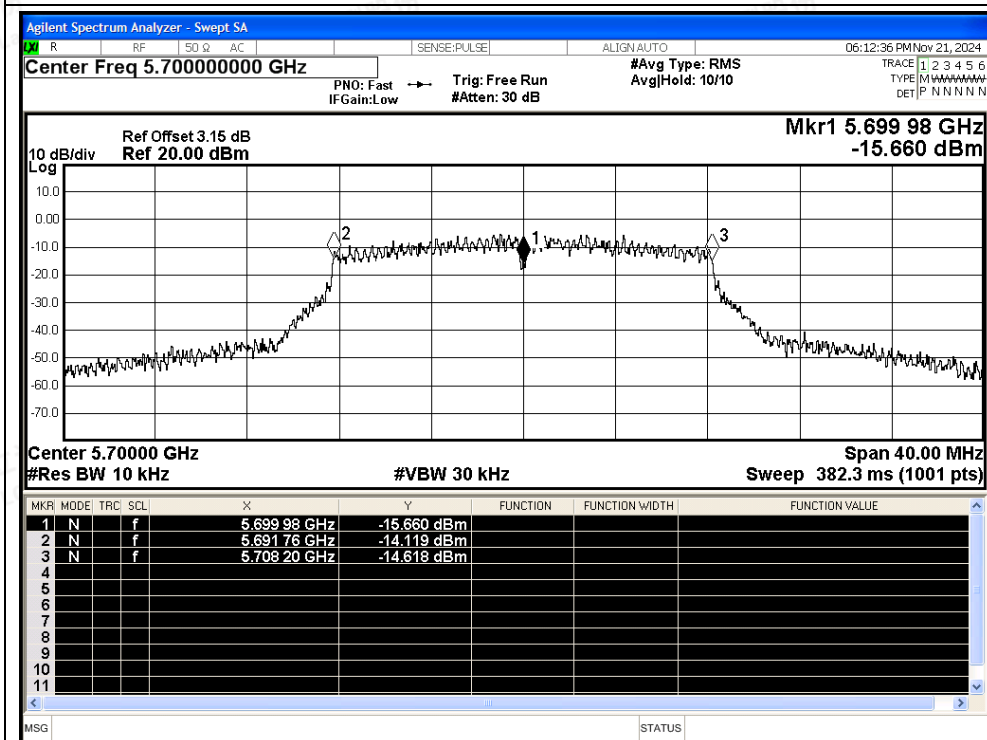

Freq. Stability NVNT n20 5500MHz Ant6

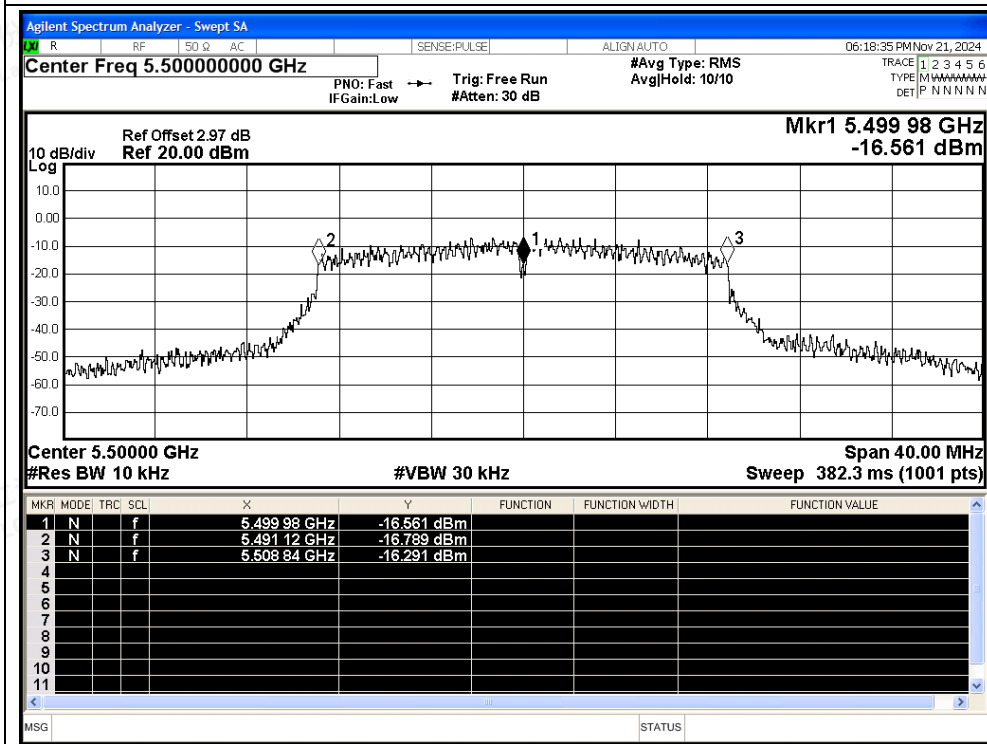

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5580MHz Ant6

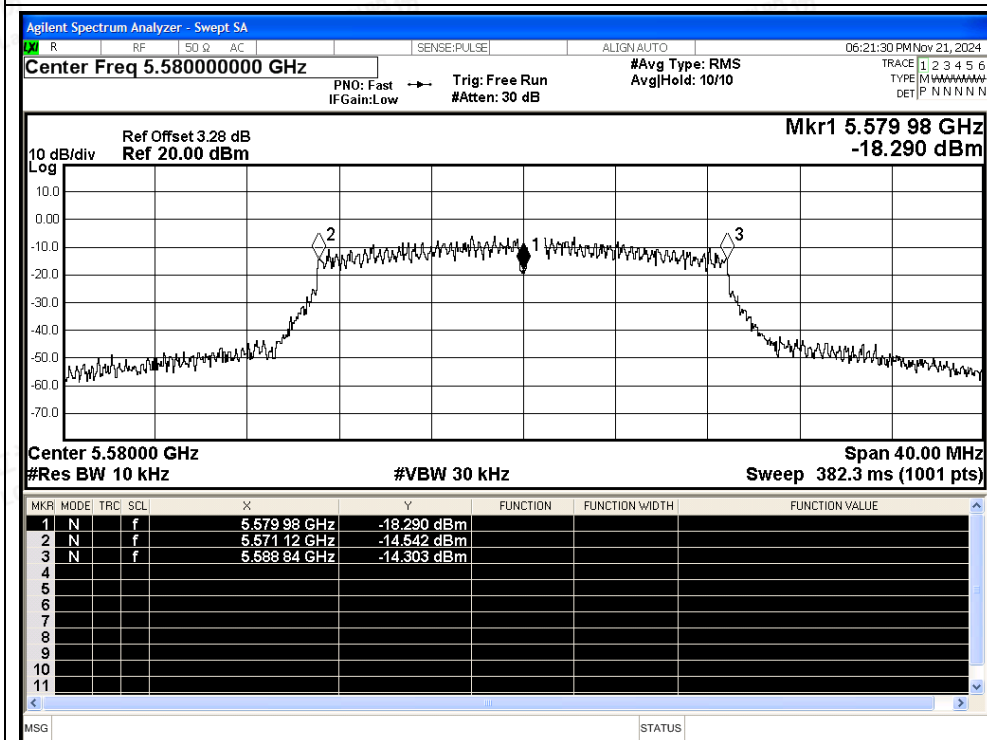

Freq. Stability NVNT n20 5700MHz Ant6

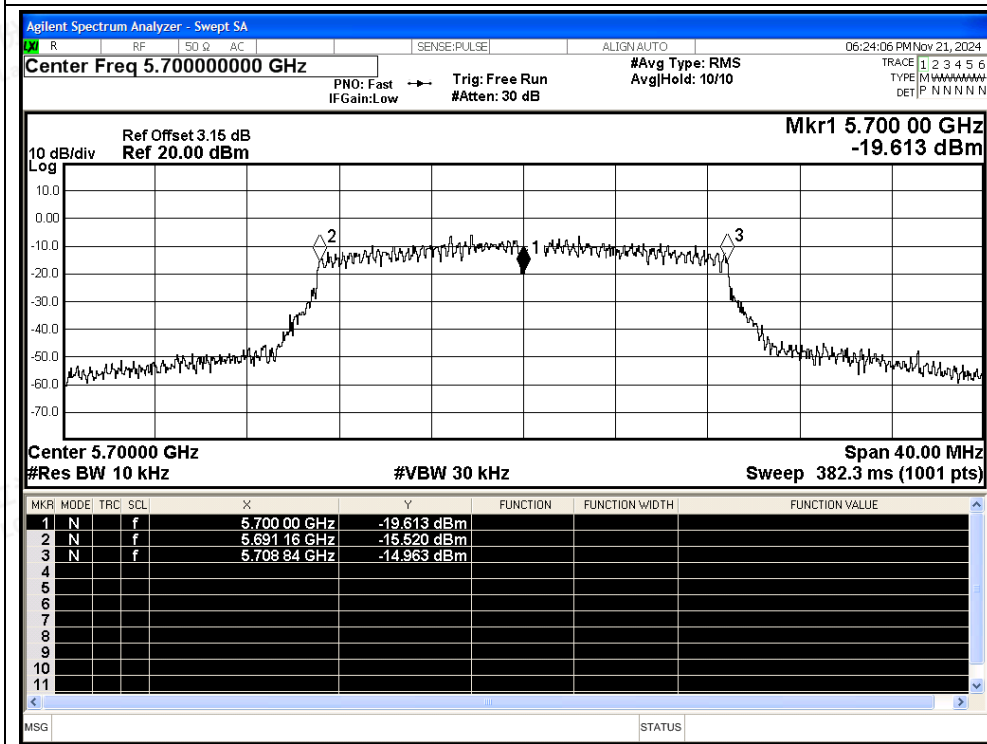

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant6

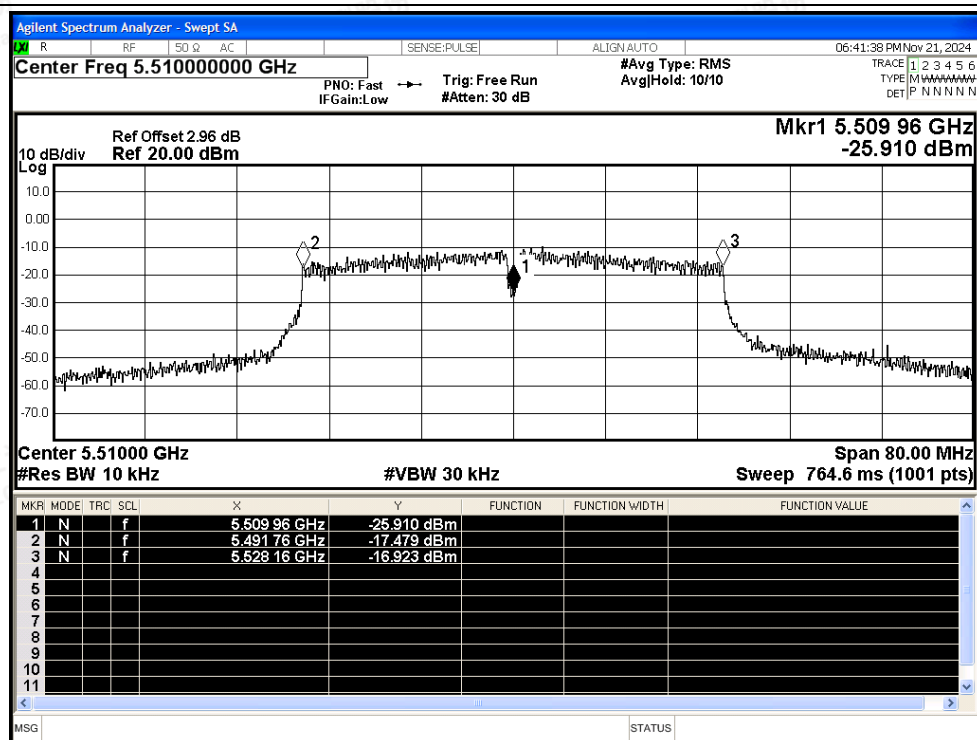

Freq. Stability NVNT n40 5550MHz Ant6

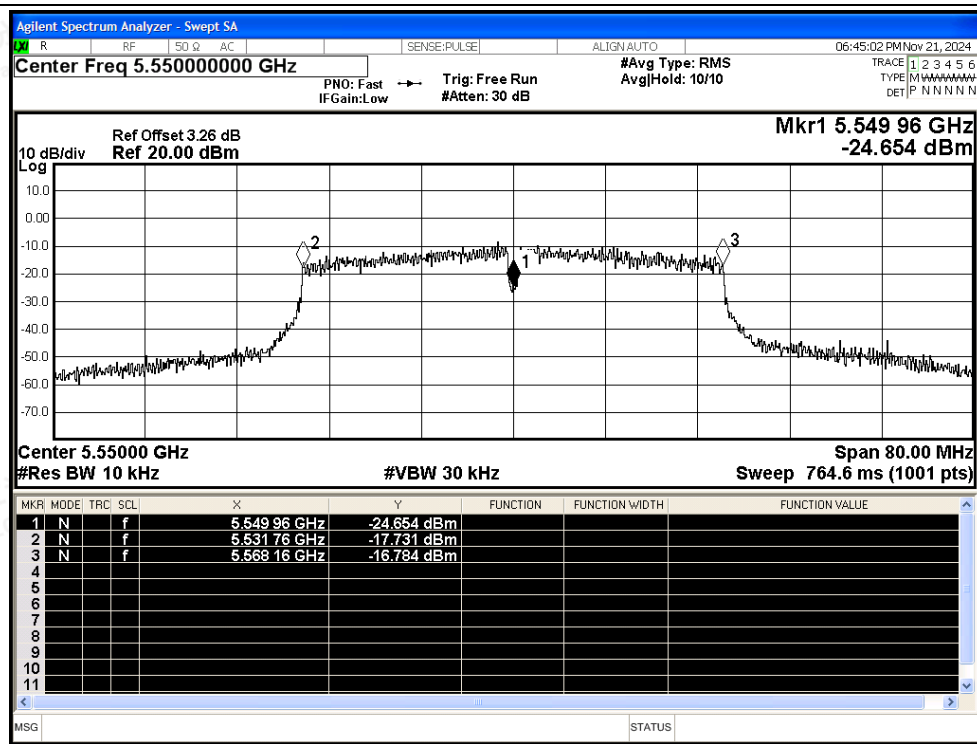

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant6

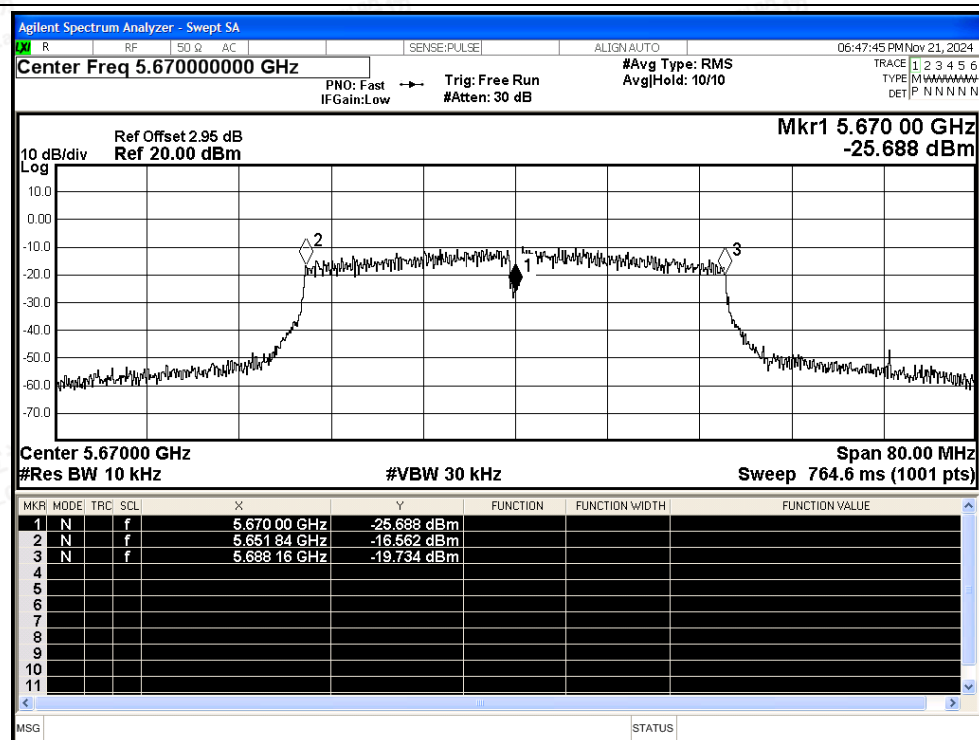

Freq. Stability NVNT ac20 5500MHz Ant6

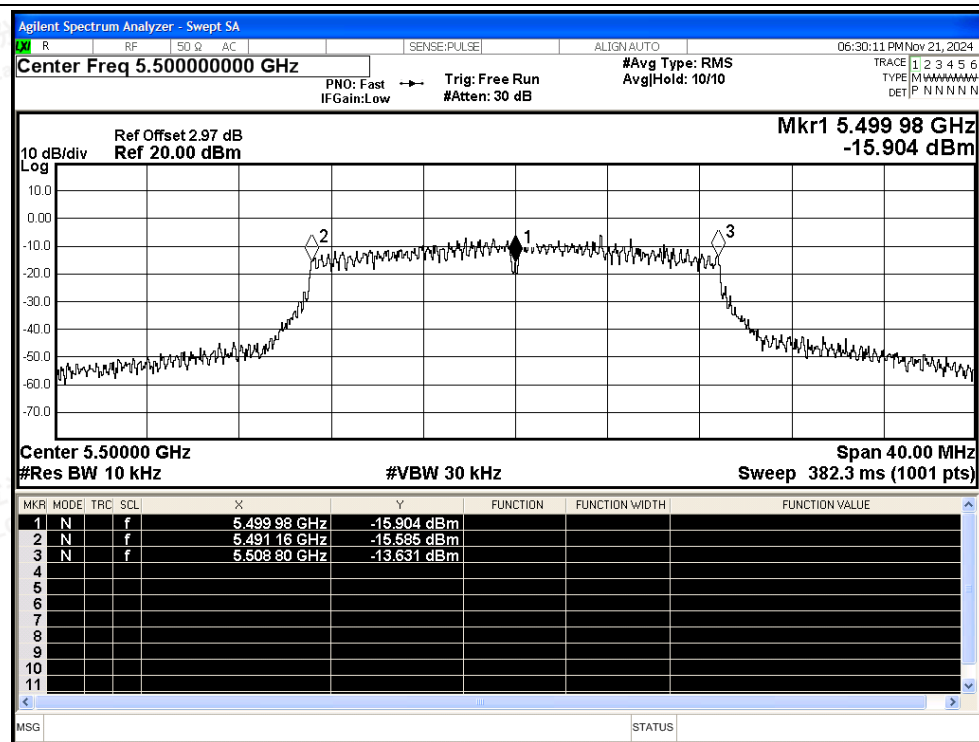

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant6

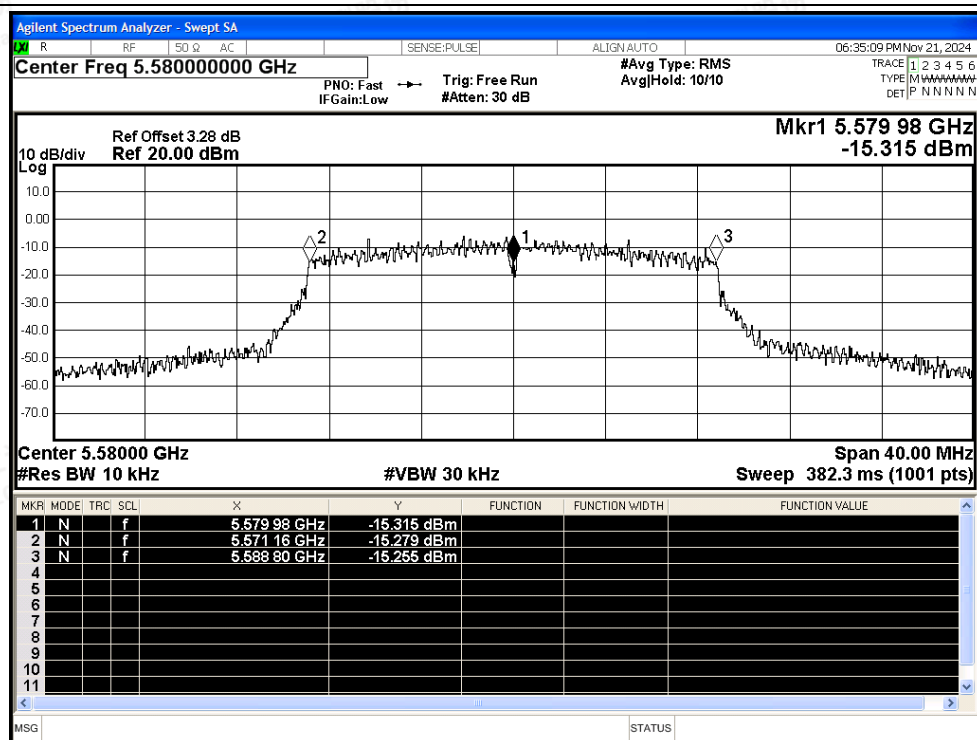

Freq. Stability NVNT ac20 5700MHz Ant6

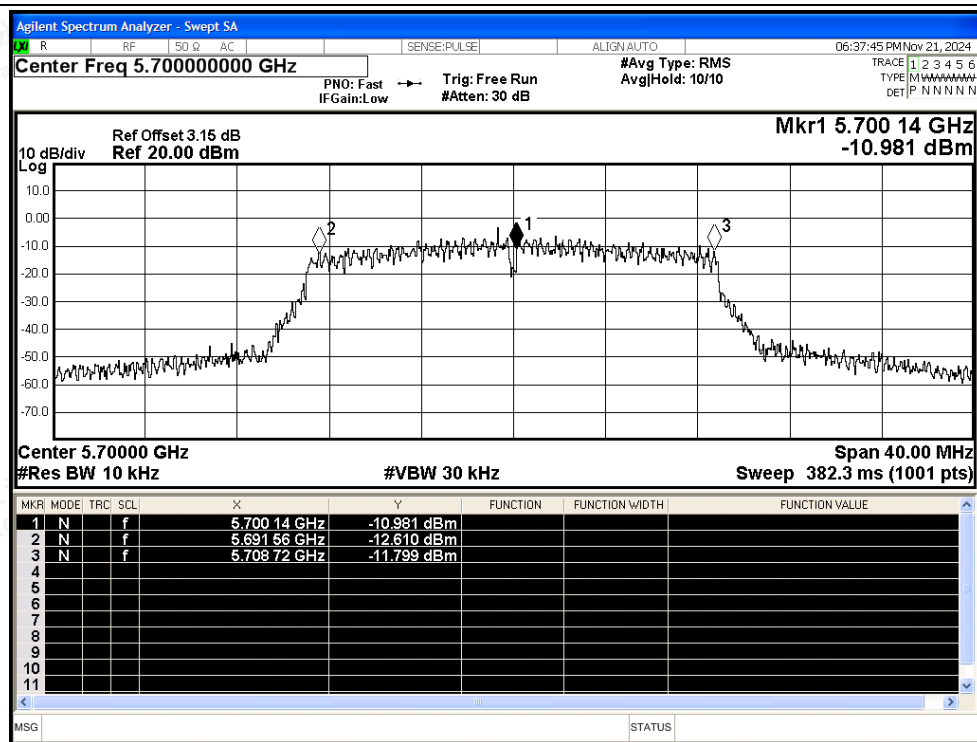

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant6

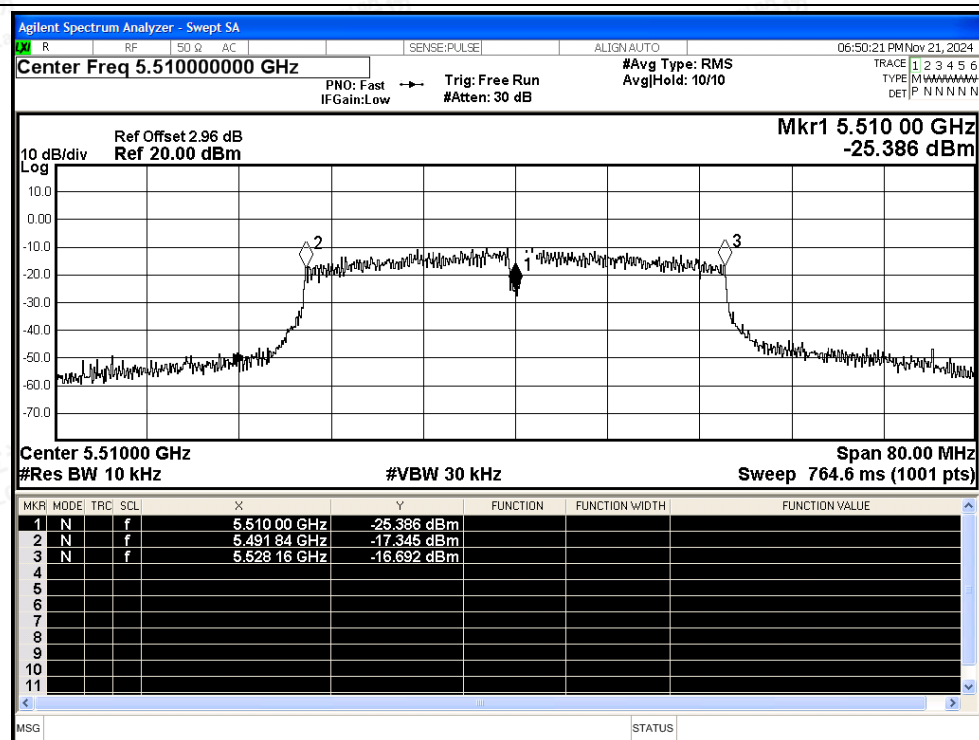

Freq. Stability NVNT ac40 5550MHz Ant6

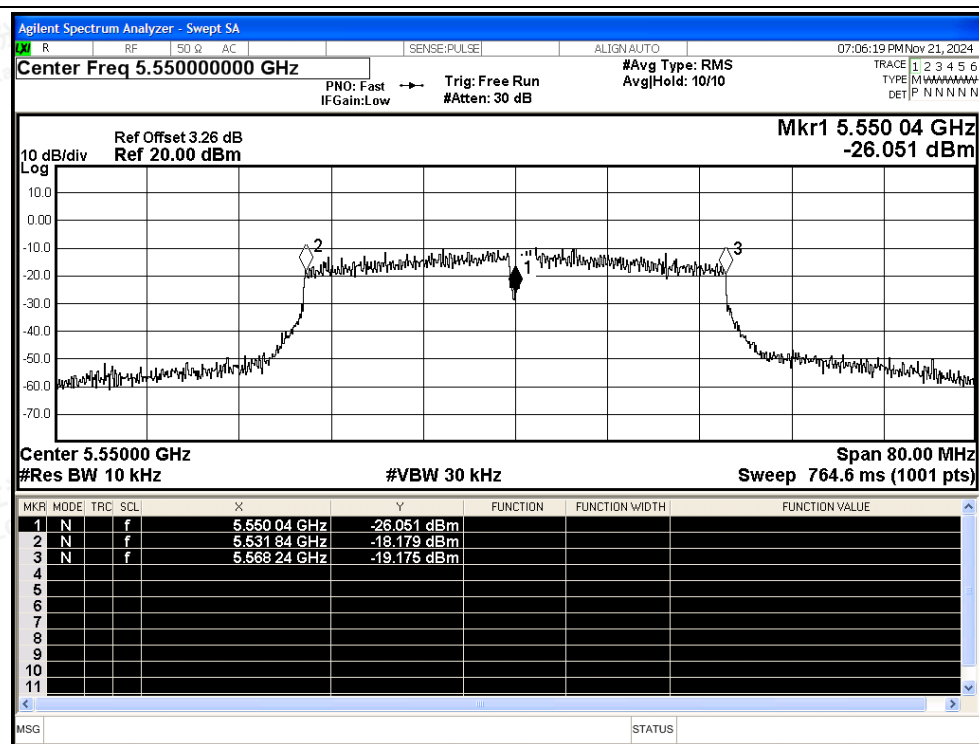

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant6

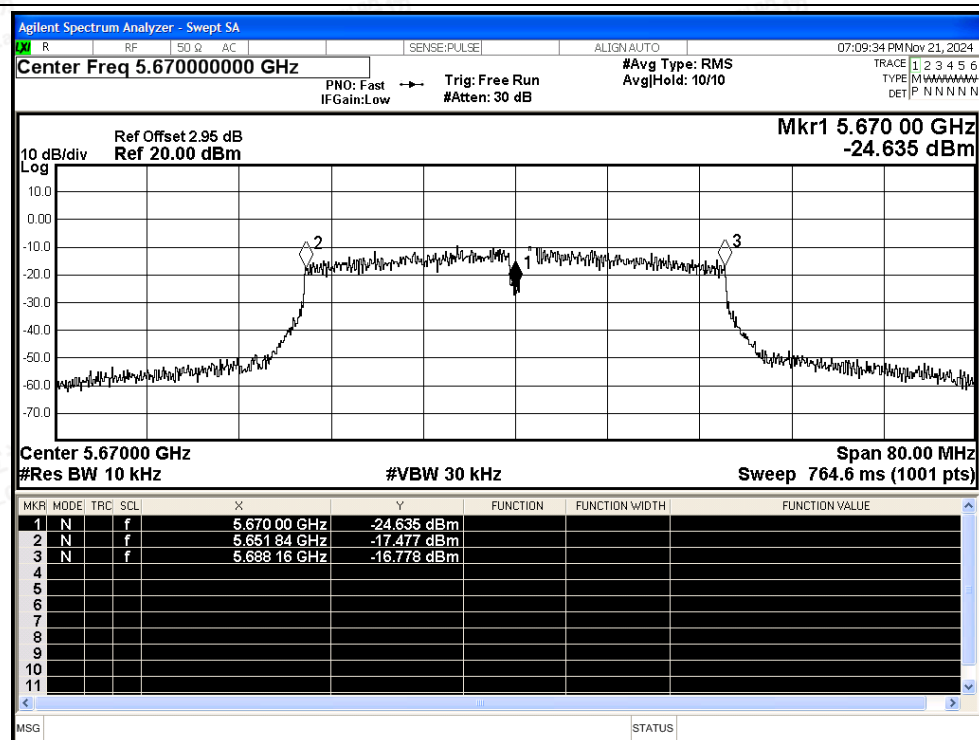

Freq. Stability NVNT ac80 5530MHz Ant6

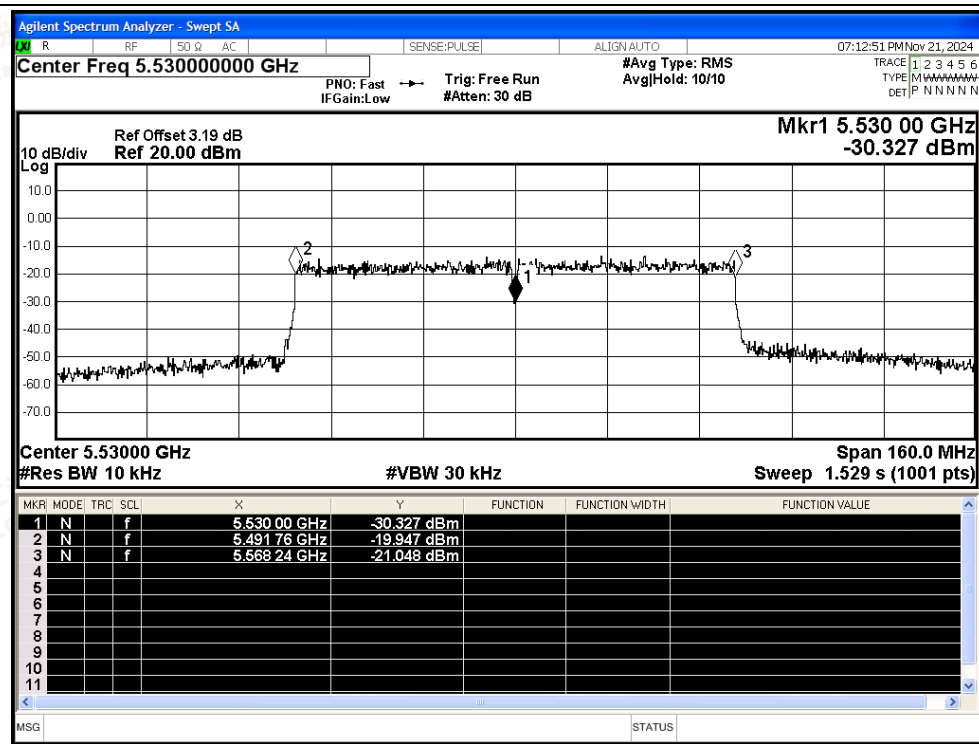

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5610MHz Ant6

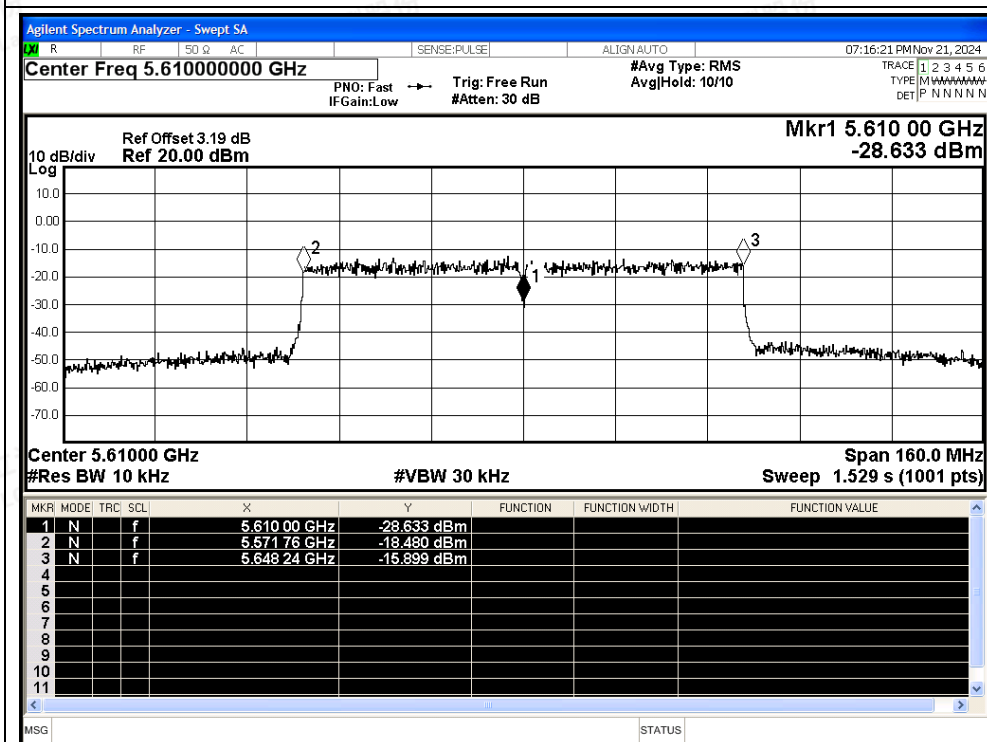

Freq. Stability NVNT ax20 5500MHz Ant6

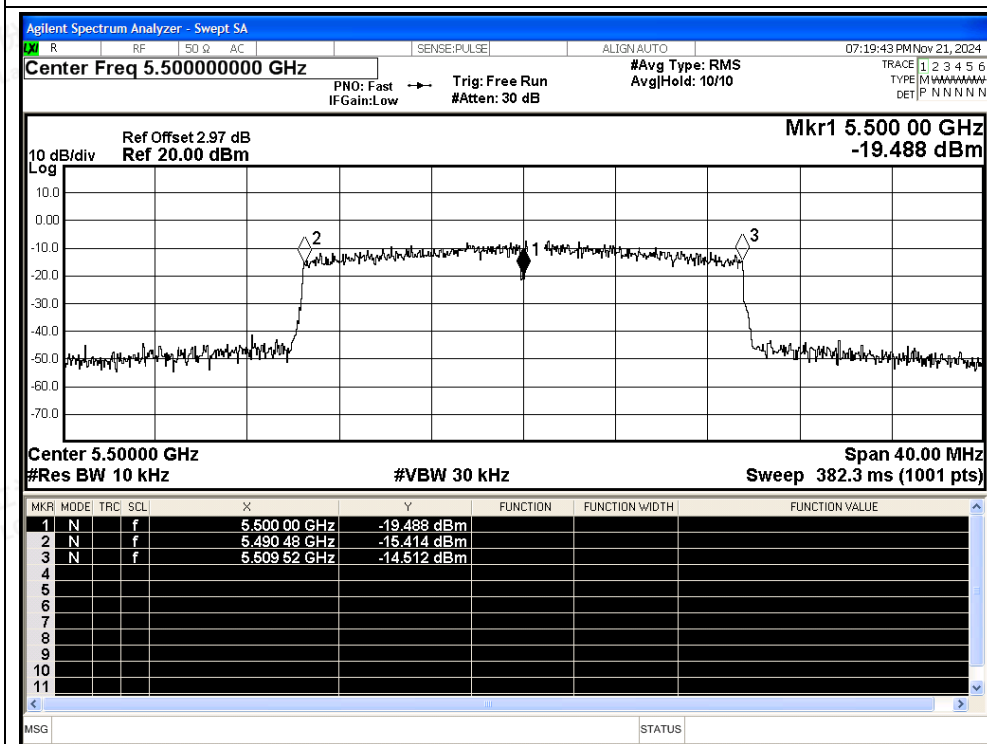

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5580MHz Ant6

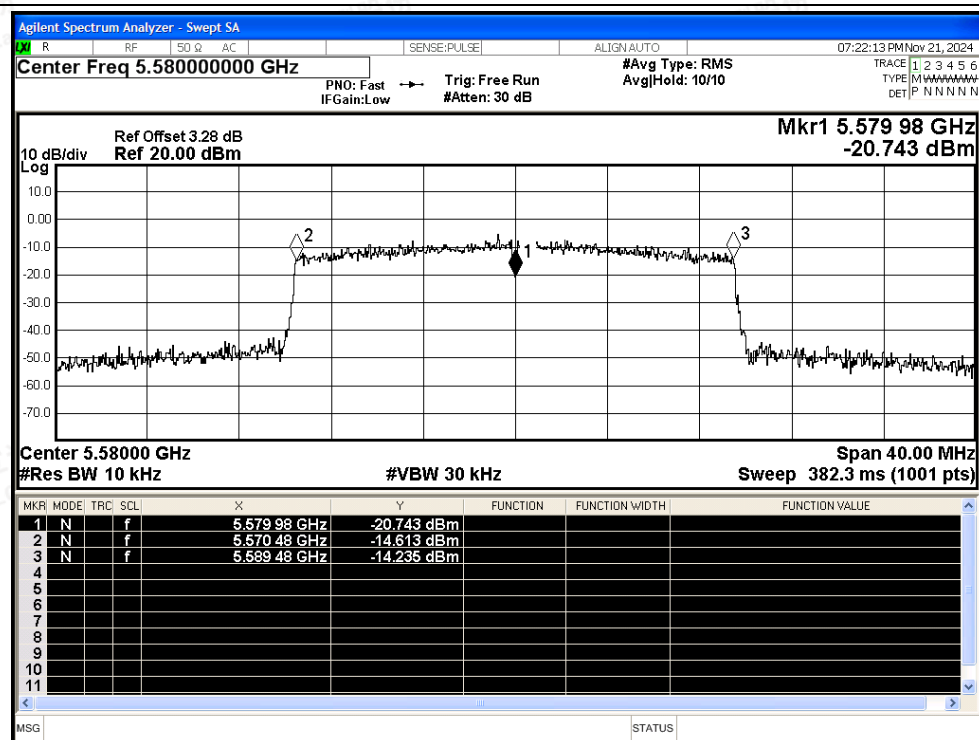

Freq. Stability NVNT ax20 5700MHz Ant6

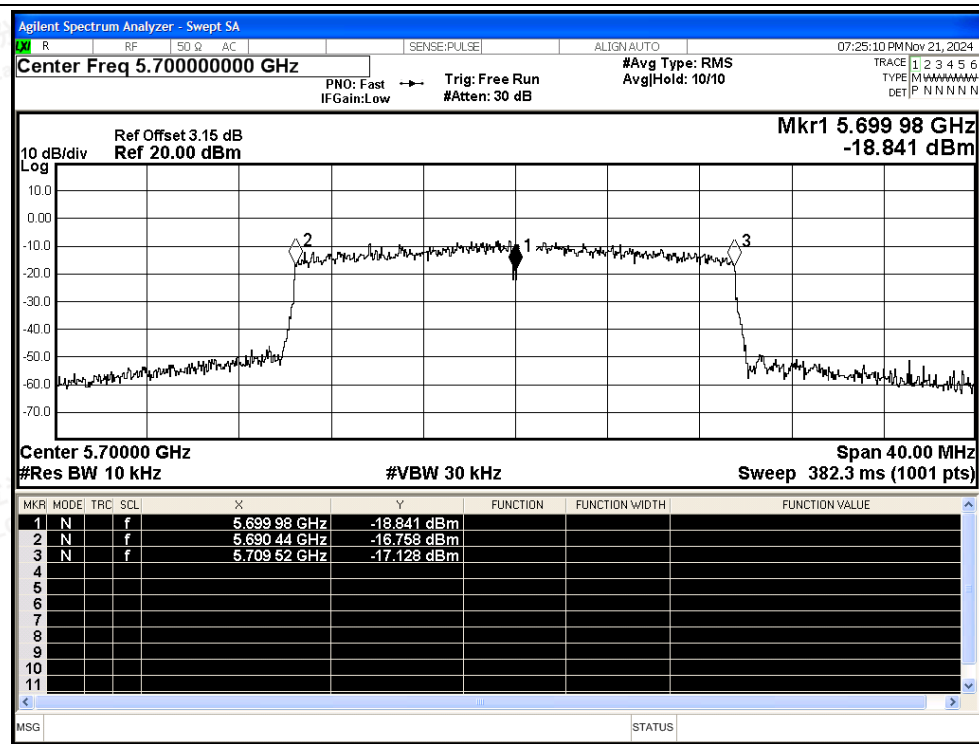

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5510MHz Ant6

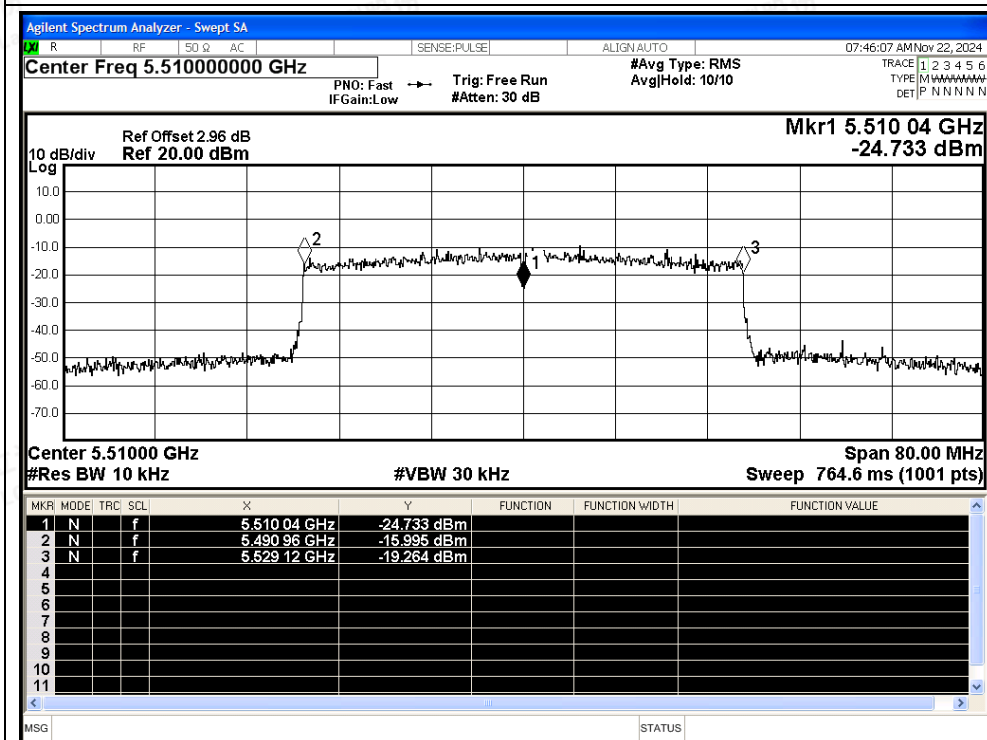

Freq. Stability NVNT ax40 5550MHz Ant6

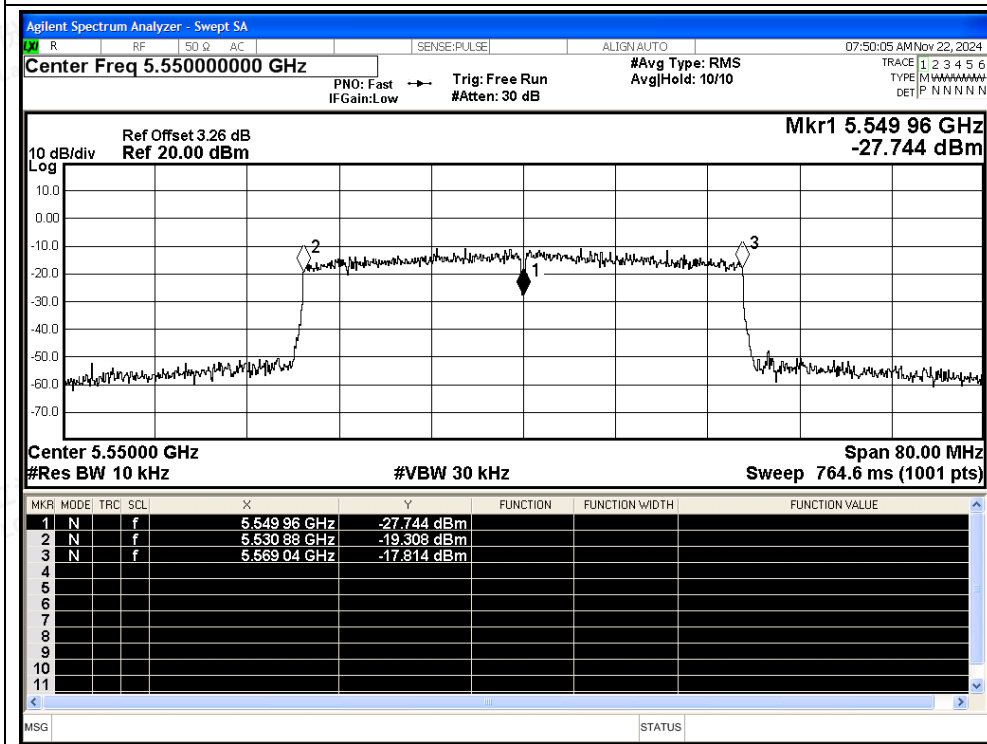

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5670MHz Ant6

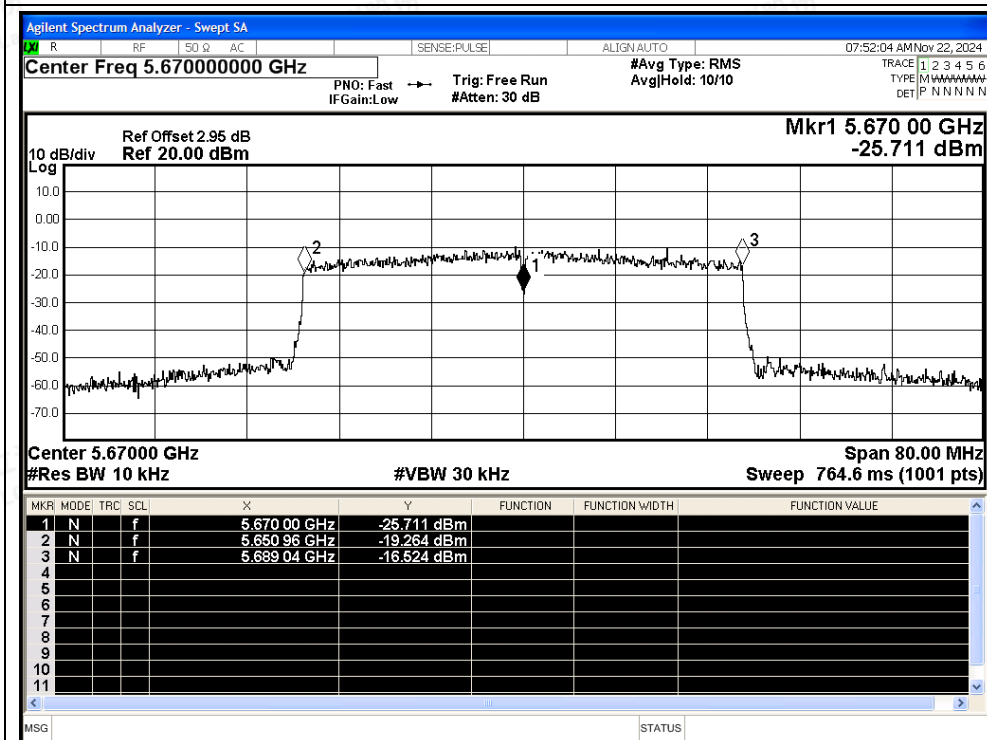

Freq. Stability NVNT ax80 5530MHz Ant6

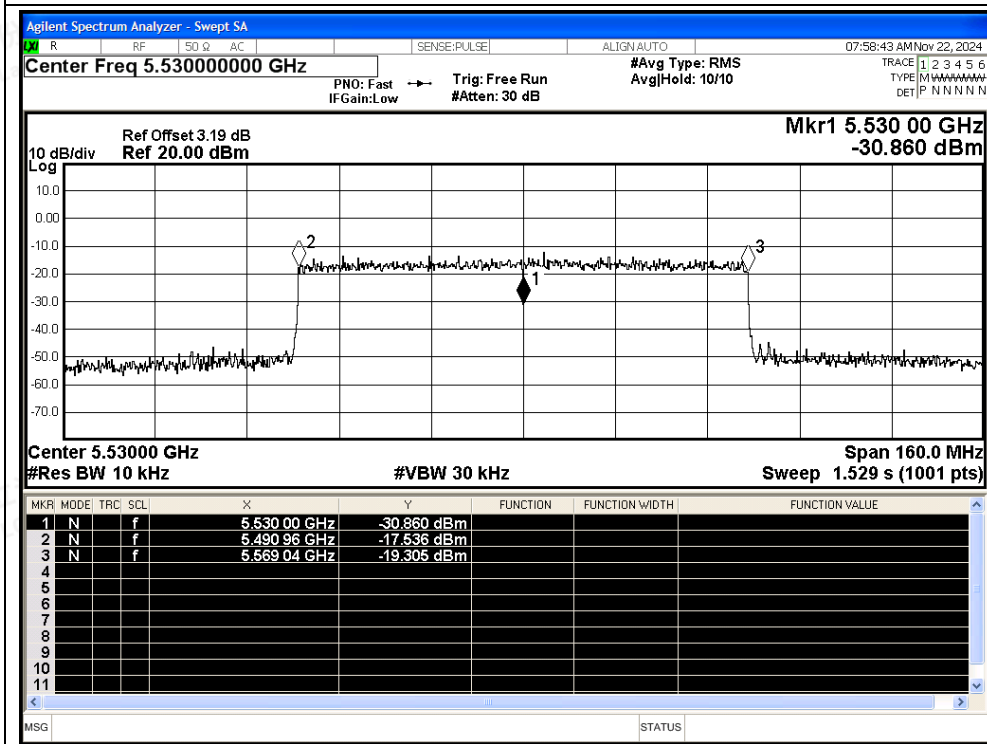


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

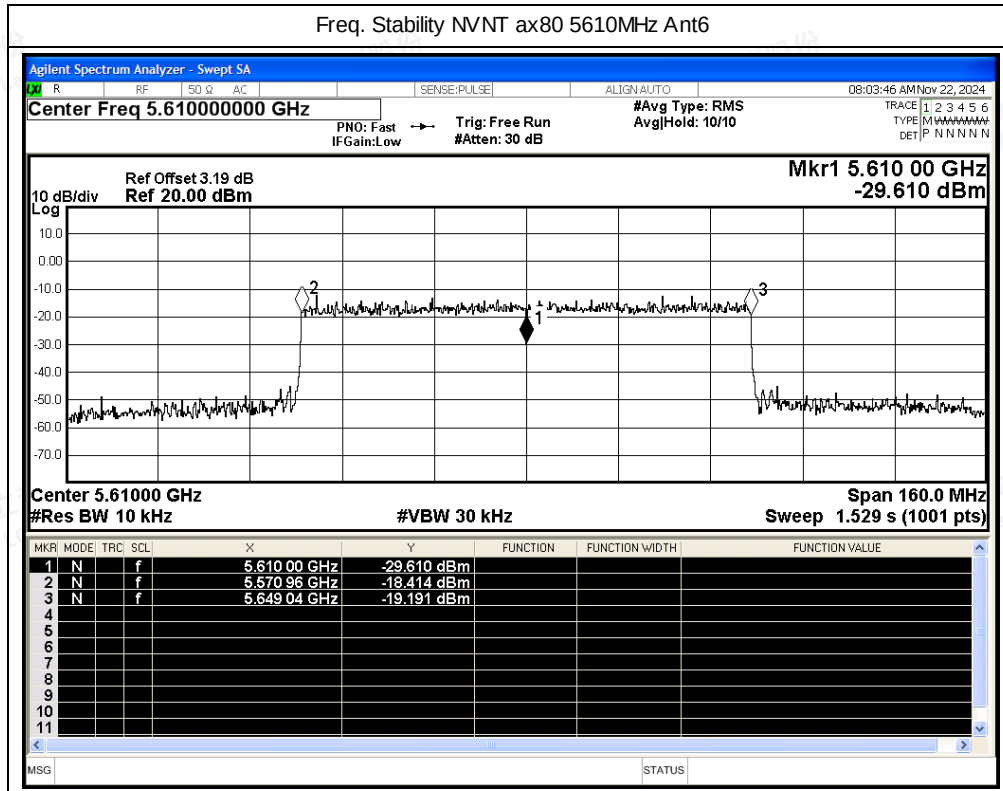

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity




Condition	Mode	Frequency (MHz)	Antenna	Measured Frequency (MHz)	Frequency Error (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
NVNT	a	5500	Ant7	5500	0	0	25	Pass
NVNT	a	5580	Ant7	5579.98	-20000	-3.58	25	Pass
NVNT	a	5700	Ant7	5699.98	-20000	-3.51	25	Pass
NVNT	n20	5500	Ant7	5500.02	20000	3.64	25	Pass
NVNT	n20	5580	Ant7	5579.98	-20000	-3.58	25	Pass
NVNT	n20	5700	Ant7	5699.98	-20000	-3.51	25	Pass
NVNT	n40	5510	Ant7	5510	0	0	25	Pass
NVNT	n40	5550	Ant7	5550.08	80000	14.41	25	Pass
NVNT	n40	5670	Ant7	5669.96	-40000	-7.05	25	Pass
NVNT	ac20	5500	Ant7	5499.98	-20000	-3.64	25	Pass
NVNT	ac20	5580	Ant7	5580	0	0	25	Pass
NVNT	ac20	5700	Ant7	5699.98	-20000	-3.51	25	Pass
NVNT	ac40	5510	Ant7	5509.96	-40000	-7.26	25	Pass
NVNT	ac40	5550	Ant7	5550.04	40000	7.21	25	Pass
NVNT	ac40	5670	Ant7	5669.96	-40000	-7.05	25	Pass
NVNT	ac80	5530	Ant7	5530	0	0	25	Pass
NVNT	ac80	5610	Ant7	5610	0	0	25	Pass
NVNT	ax20	5500	Ant7	5500	0	0	25	Pass
NVNT	ax20	5580	Ant7	5580	0	0	25	Pass
NVNT	ax20	5700	Ant7	5699.98	-20000	-3.51	25	Pass
NVNT	ax40	5510	Ant7	5509.96	-40000	-7.26	25	Pass
NVNT	ax40	5550	Ant7	5550	0	0	25	Pass
NVNT	ax40	5670	Ant7	5670	0	0	25	Pass
NVNT	ax80	5530	Ant7	5530	0	0	25	Pass
NVNT	ax80	5610	Ant7	5610	0	0	25	Pass






Test Graphs

Freq. Stability NVNT a 5500MHz Ant7

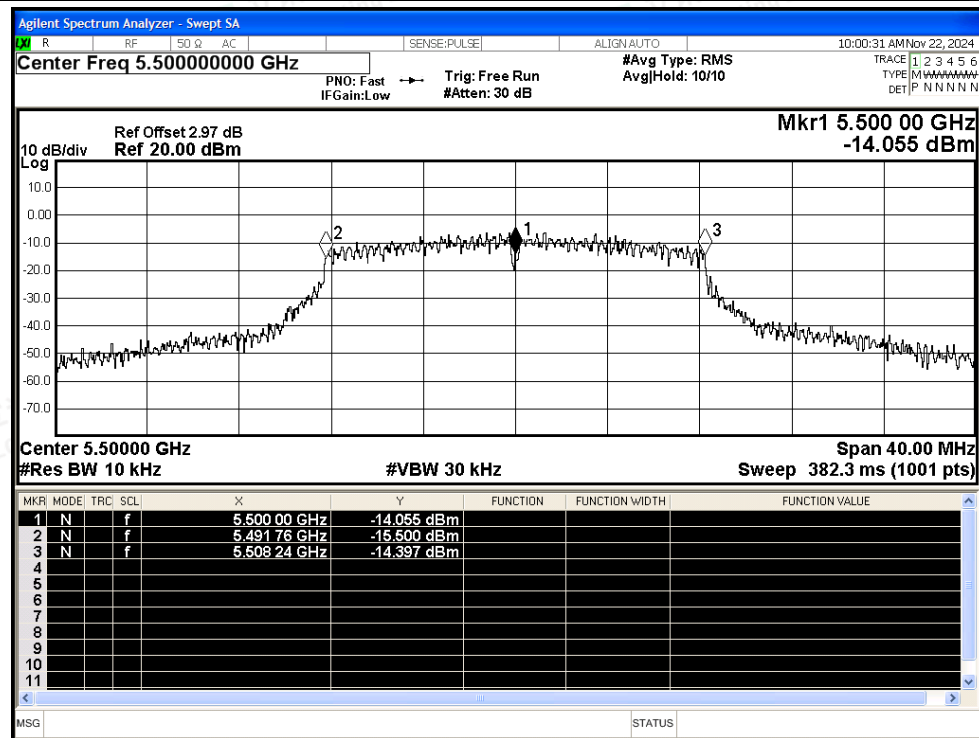

Freq. Stability NVNT a 5580MHz Ant7

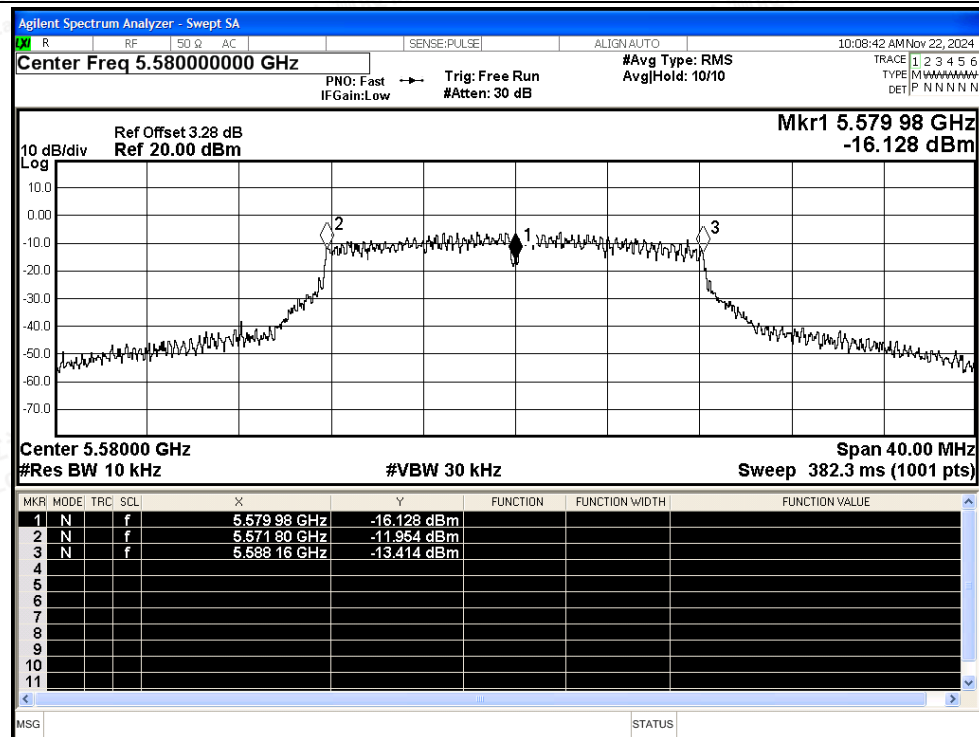

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT a 5700MHz Ant7

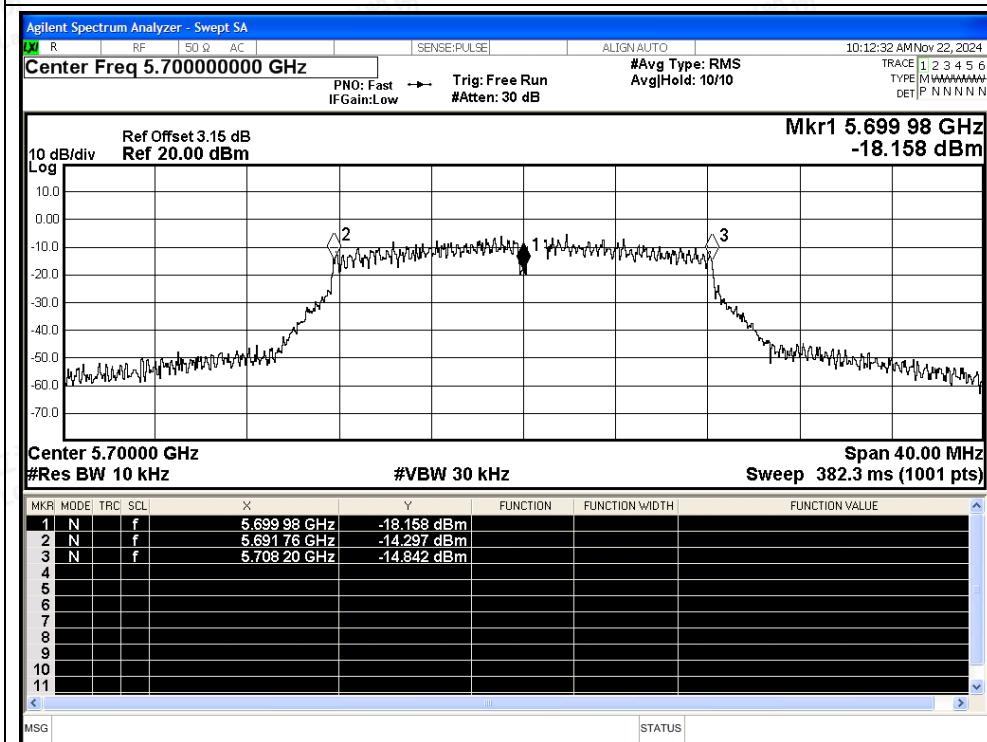

Freq. Stability NVNT n20 5500MHz Ant7

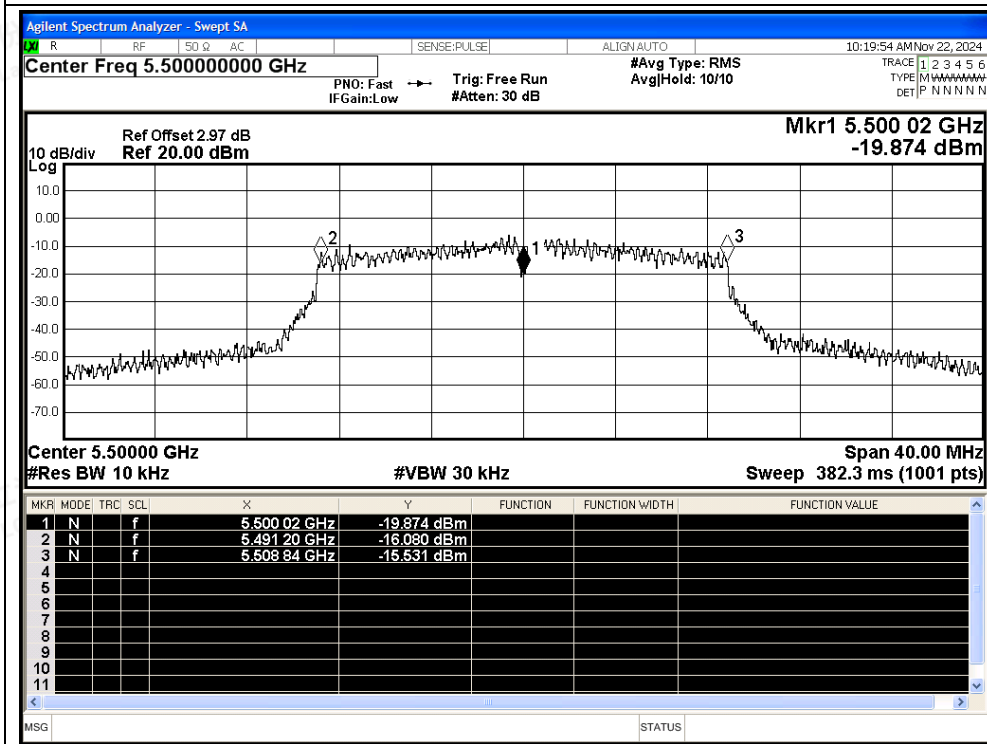

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n20 5580MHz Ant7

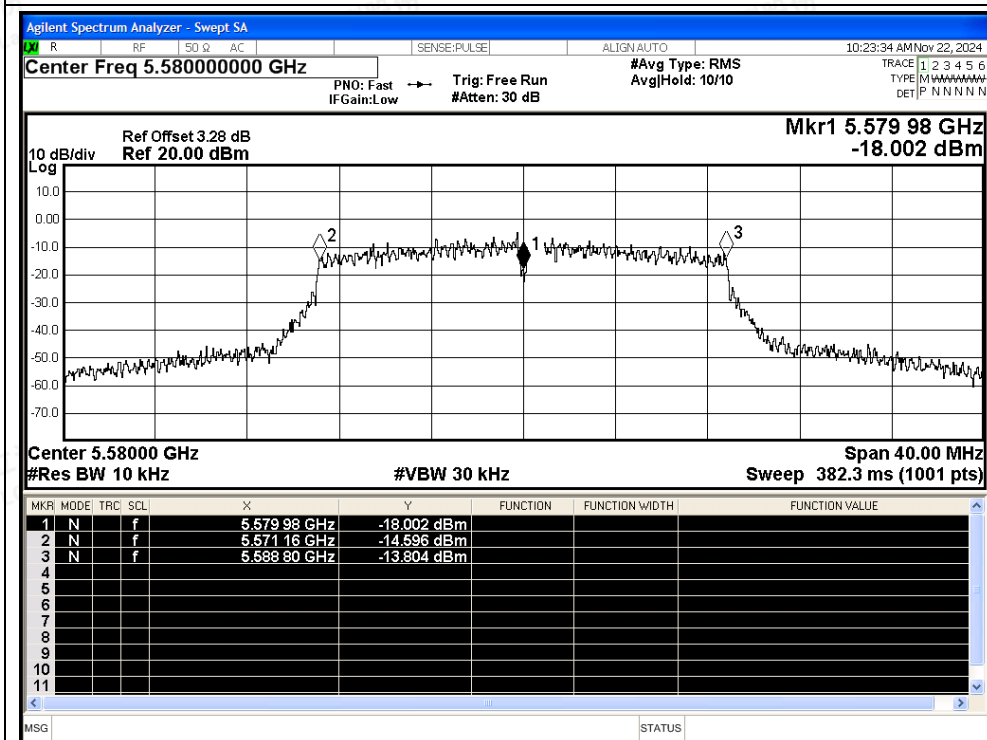

Freq. Stability NVNT n20 5700MHz Ant7

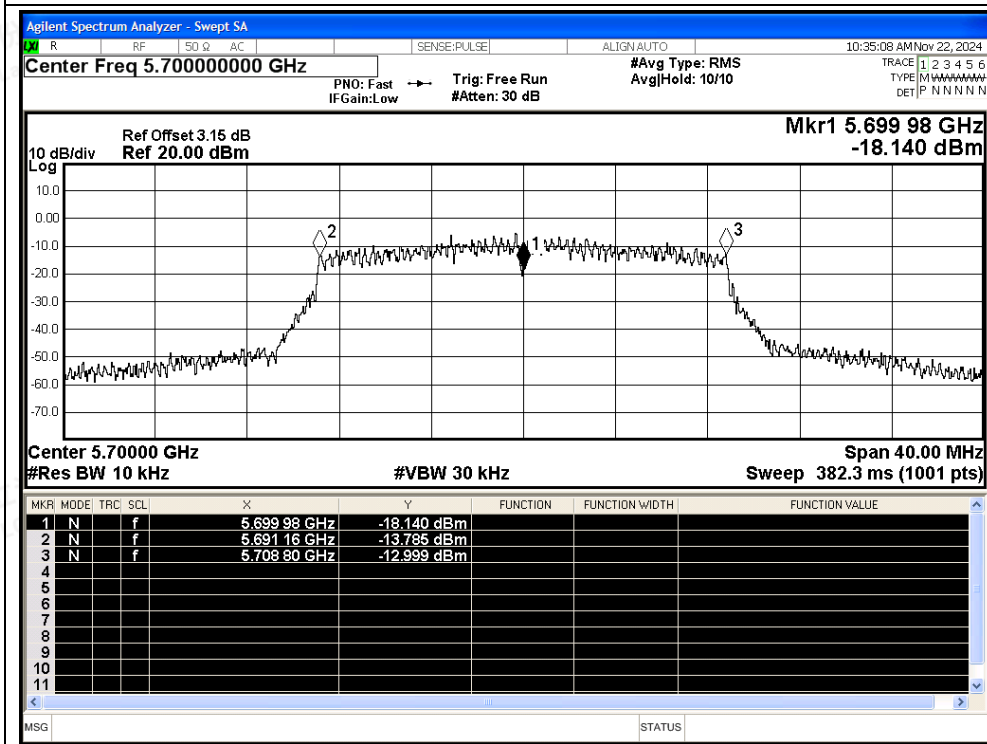

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5510MHz Ant7

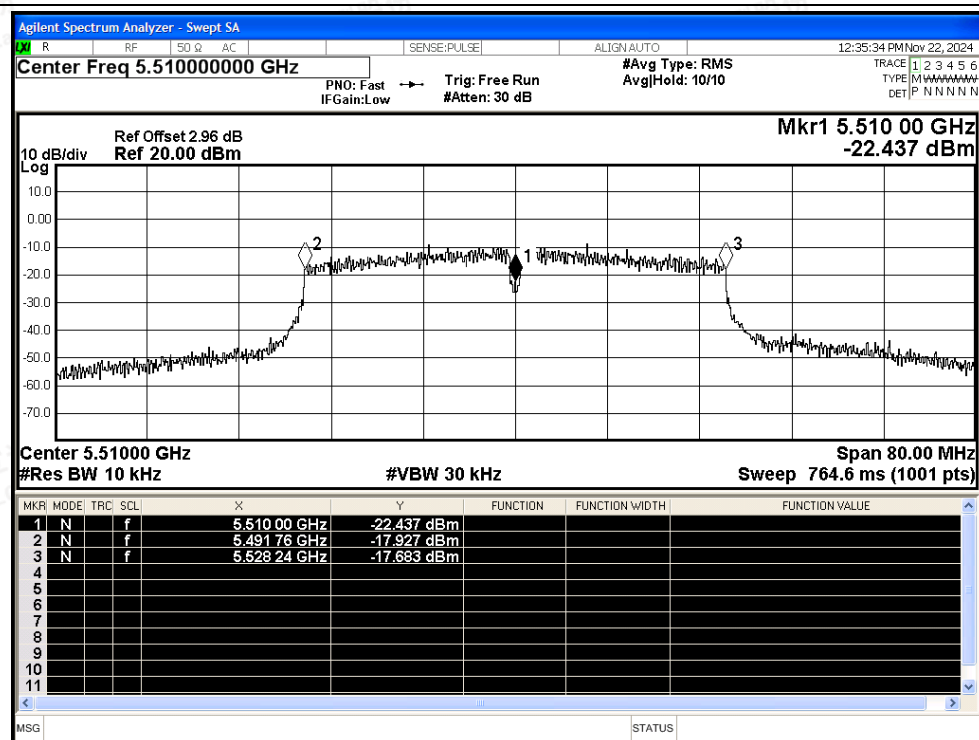

Freq. Stability NVNT n40 5550MHz Ant7

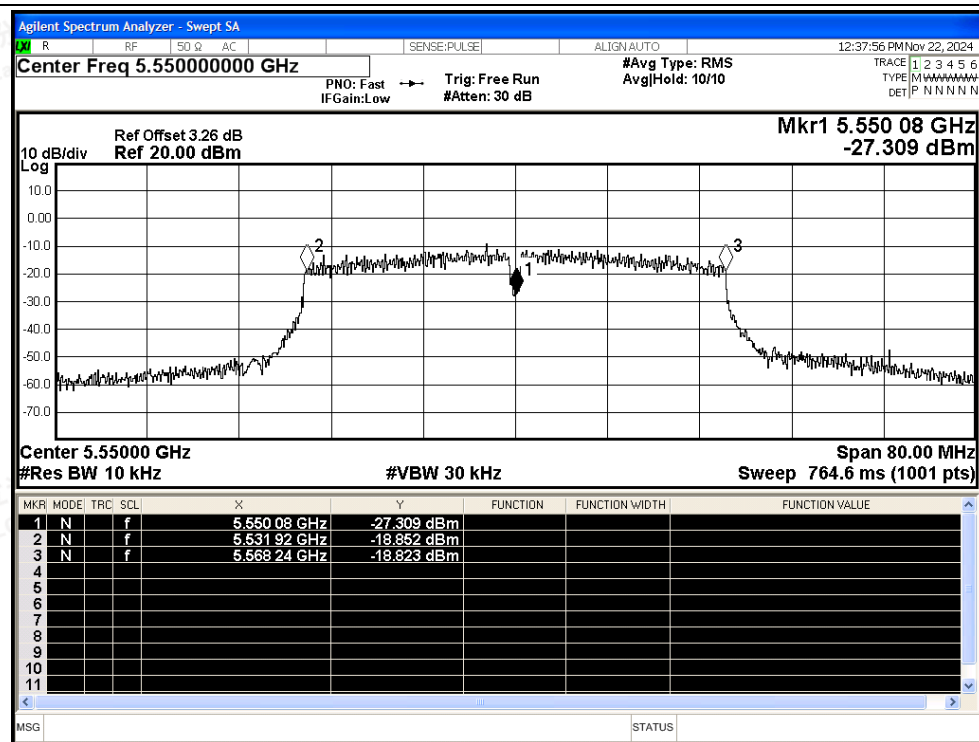

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT n40 5670MHz Ant7

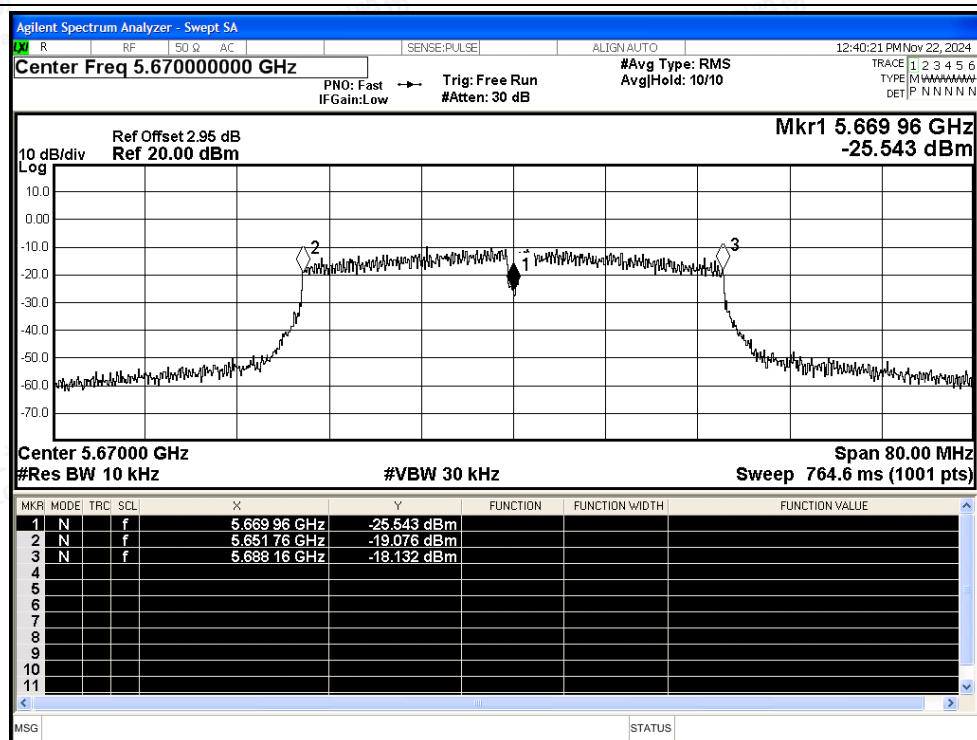

Freq. Stability NVNT ac20 5500MHz Ant7

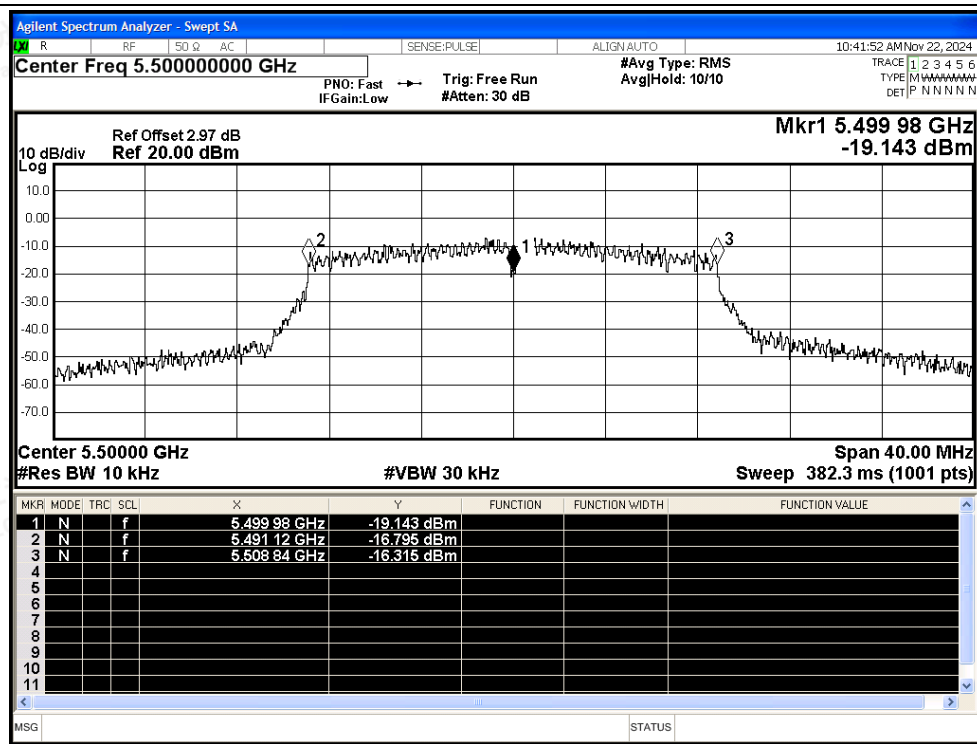

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac20 5580MHz Ant7

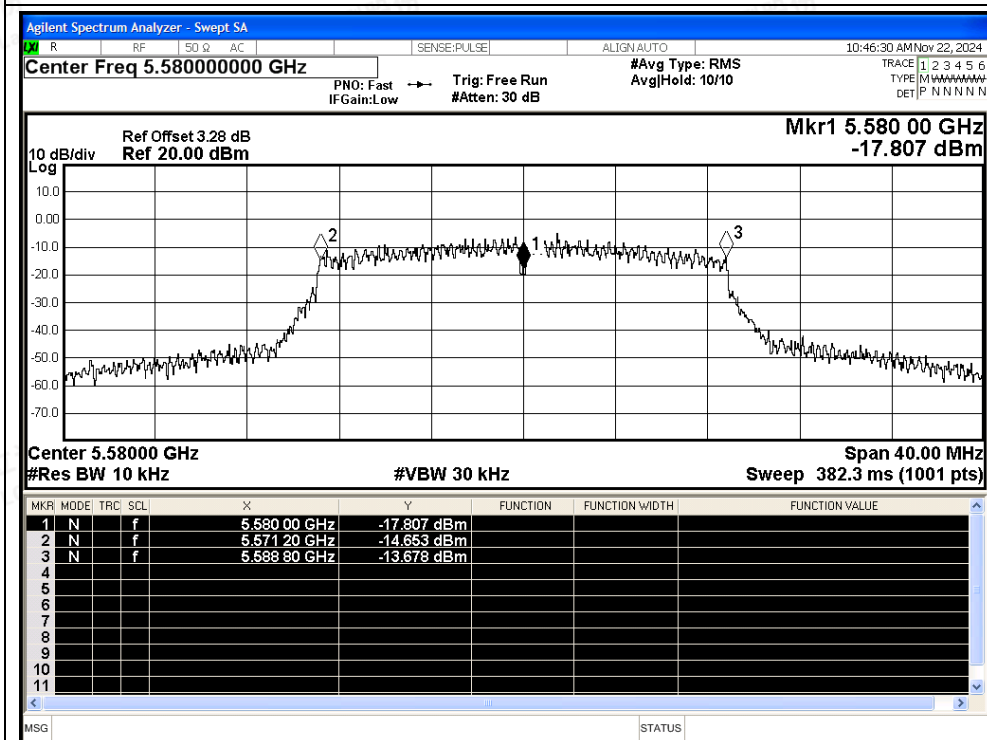

Freq. Stability NVNT ac20 5700MHz Ant7

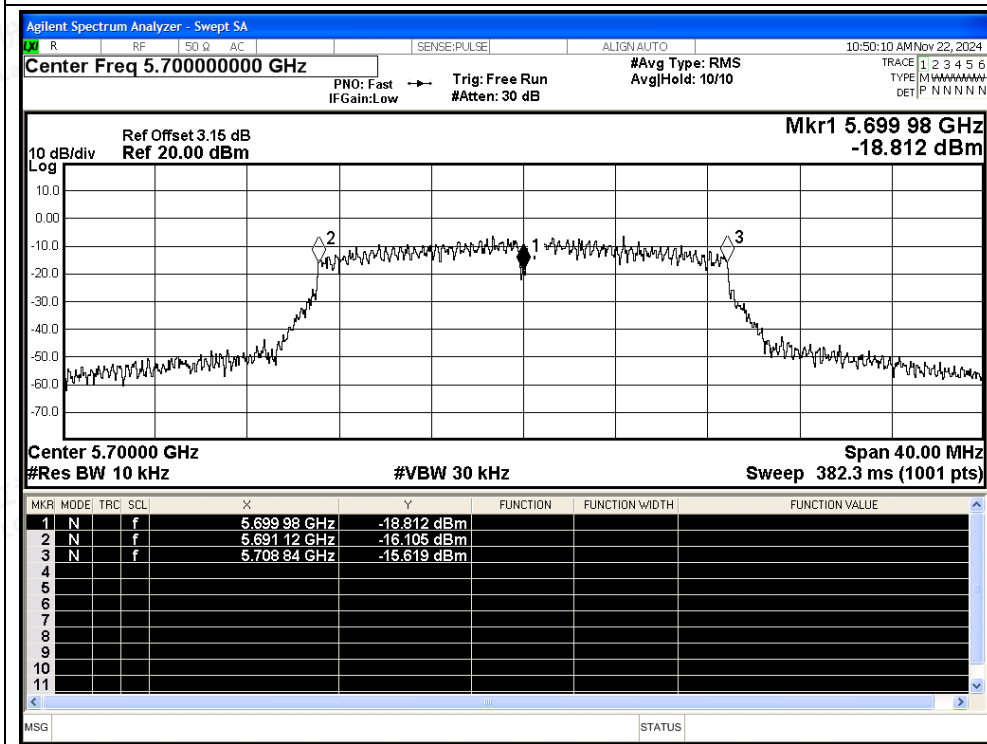

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5510MHz Ant7

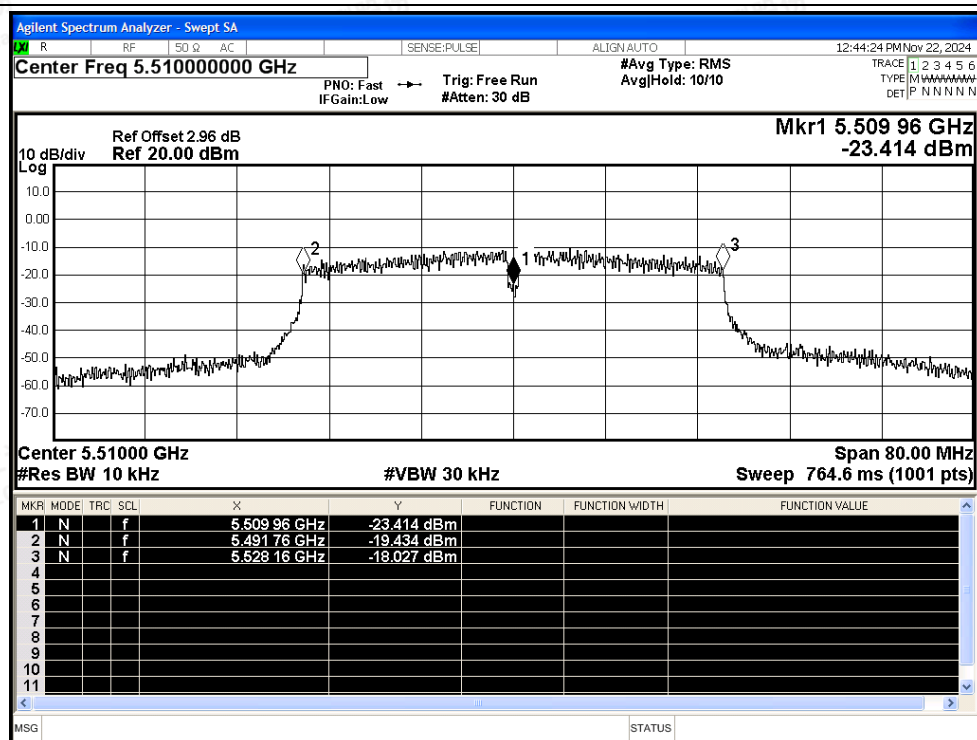

Freq. Stability NVNT ac40 5550MHz Ant7

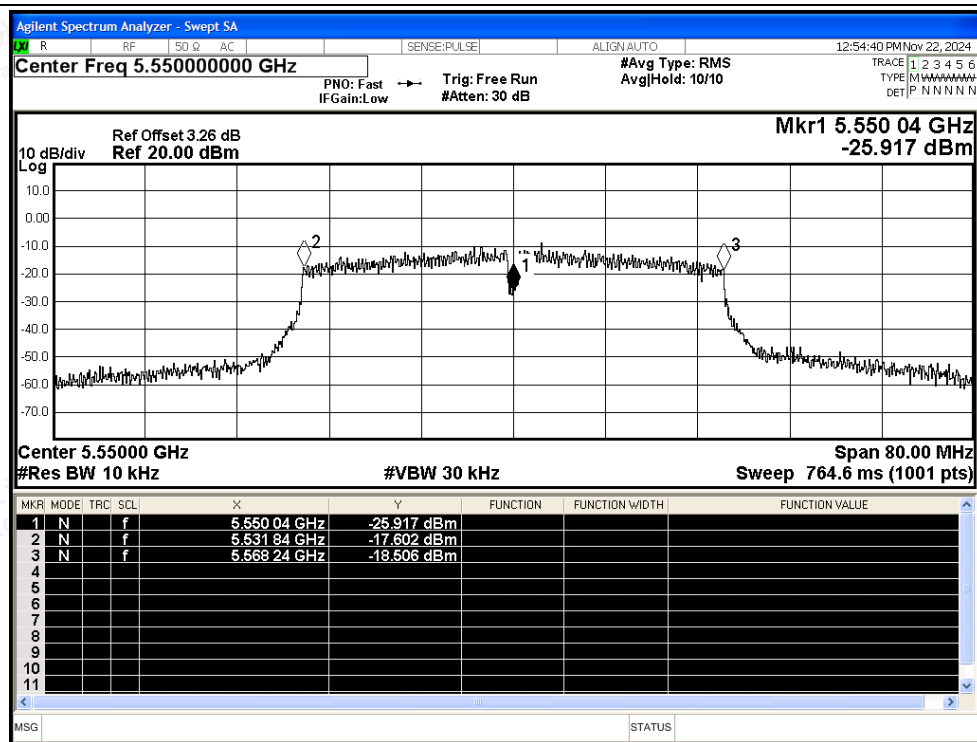

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac40 5670MHz Ant7

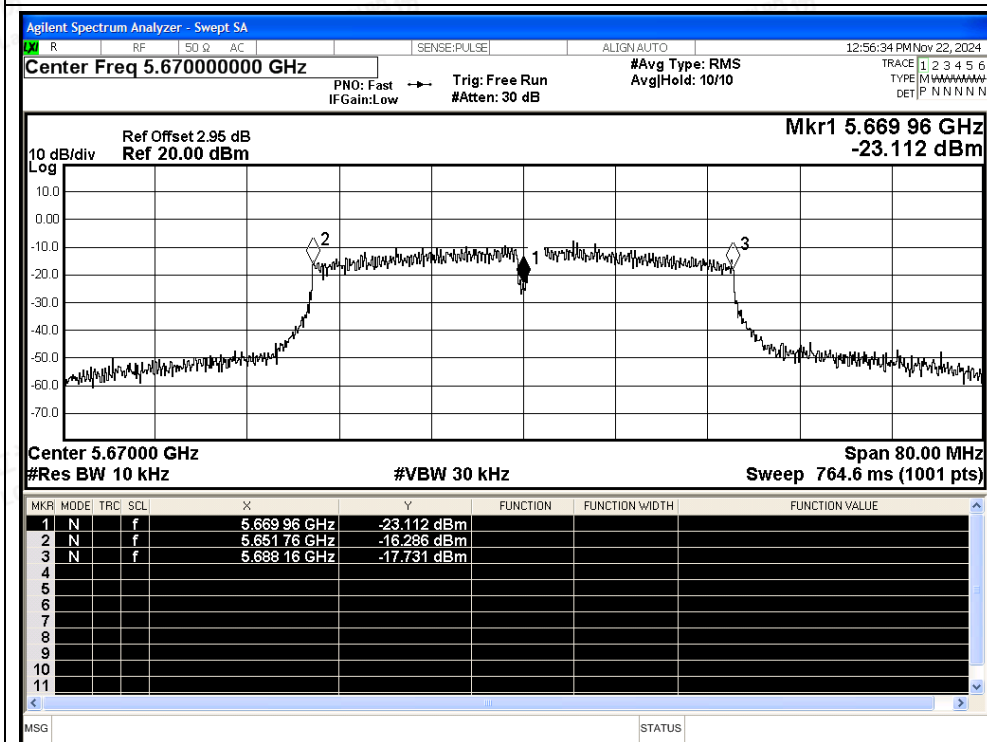

Freq. Stability NVNT ac80 5530MHz Ant7

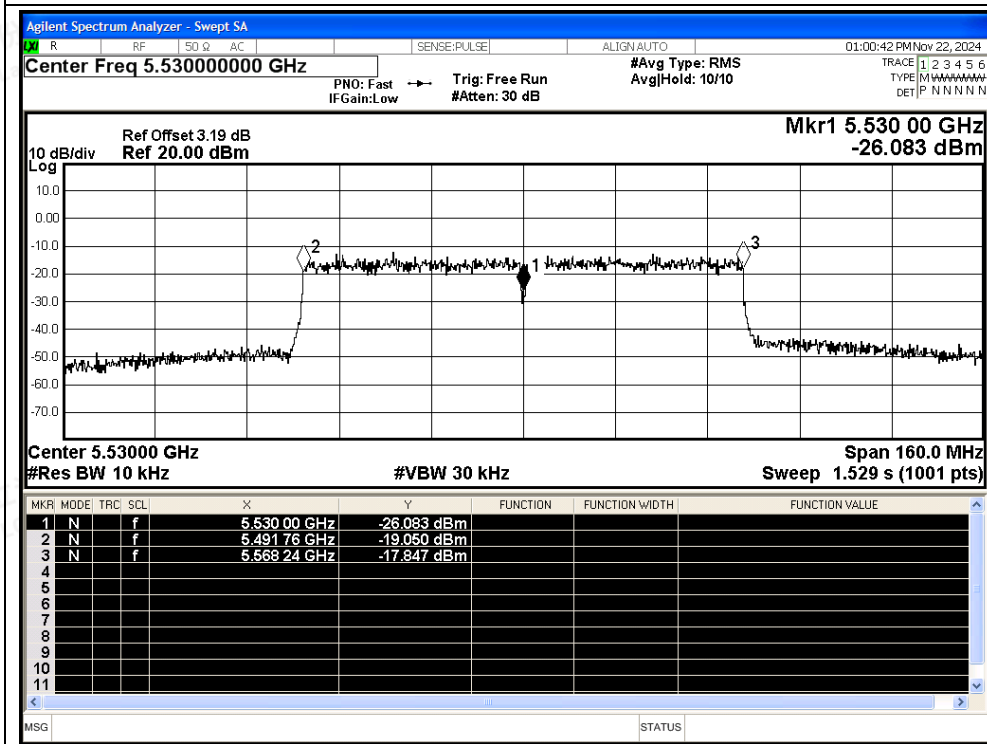

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ac80 5610MHz Ant7

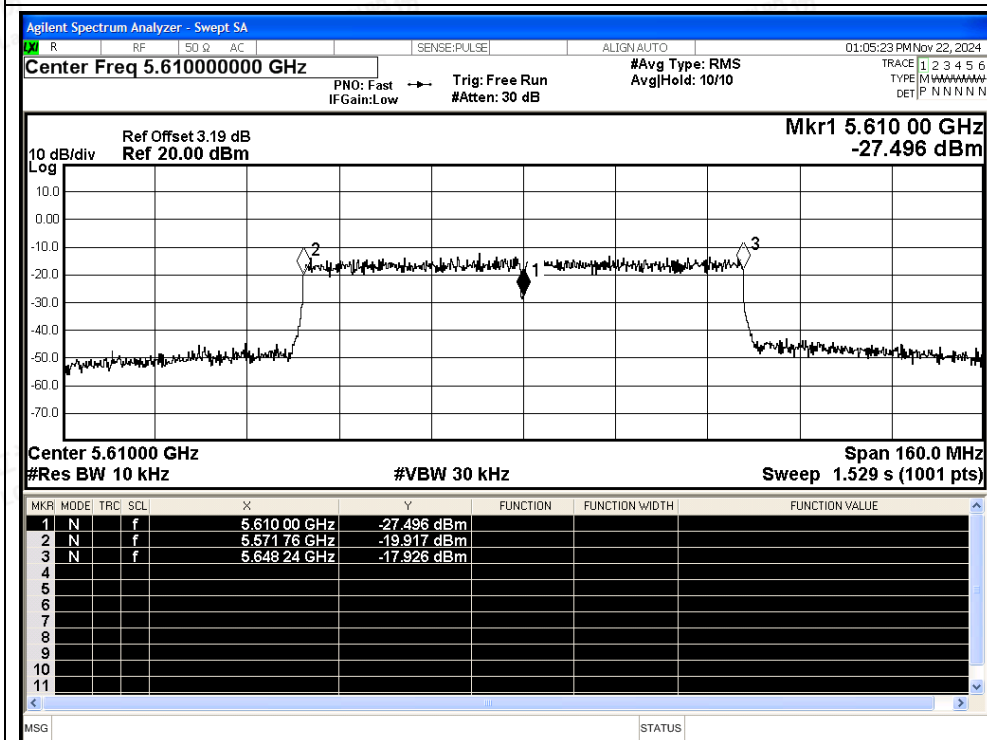

Freq. Stability NVNT ax20 5500MHz Ant7

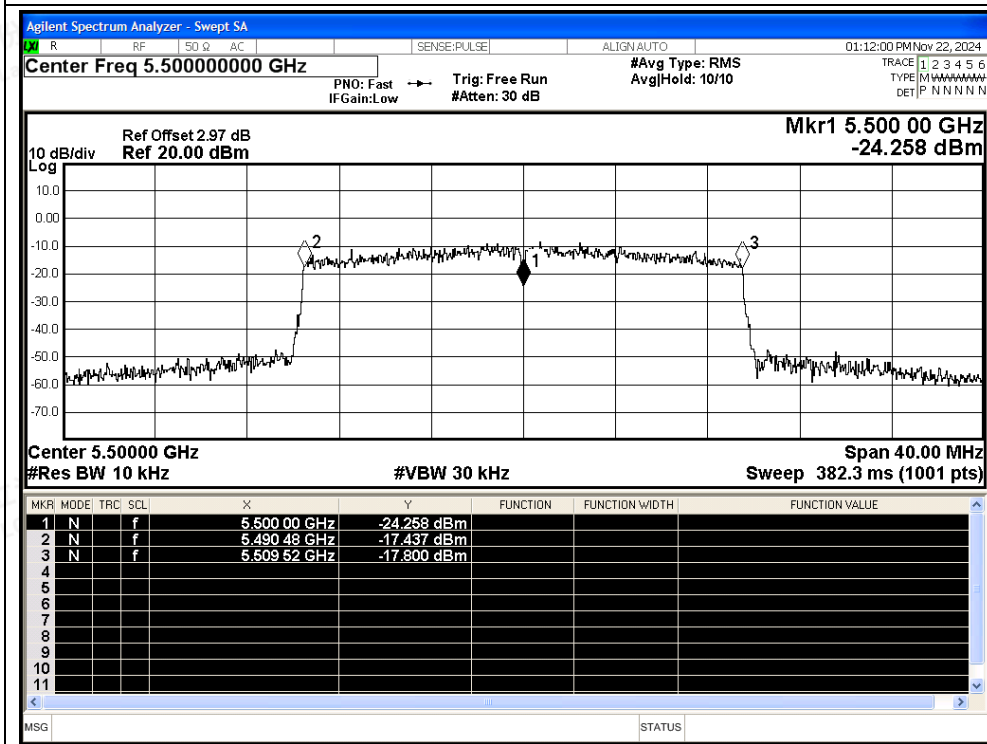

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax20 5580MHz Ant7

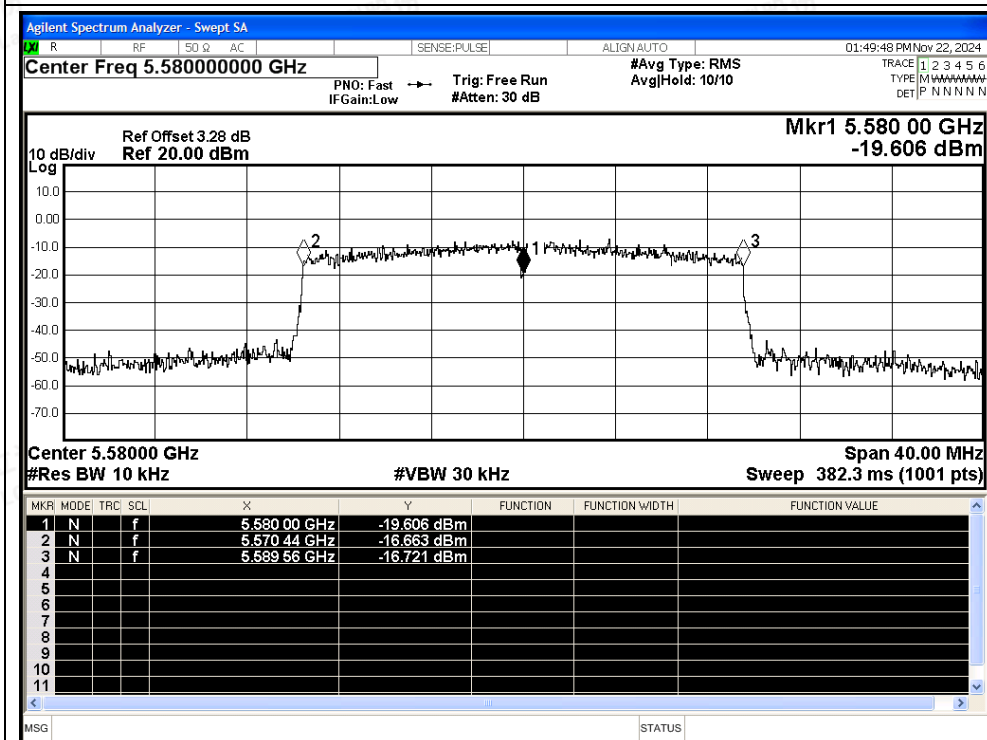

Freq. Stability NVNT ax20 5700MHz Ant7

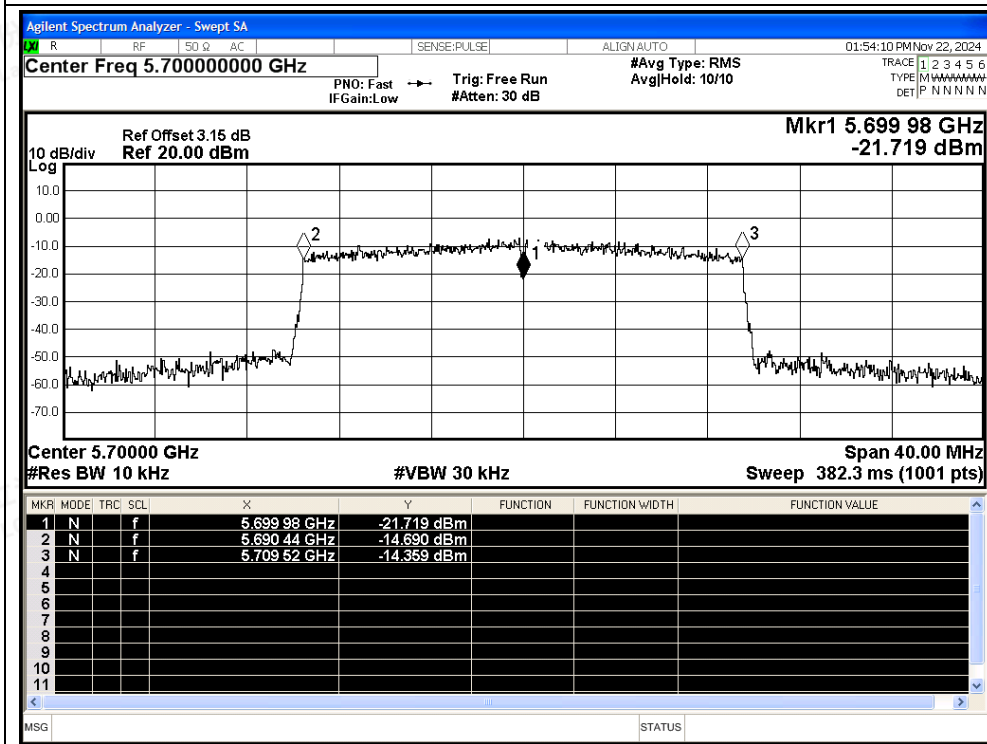

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5510MHz Ant7

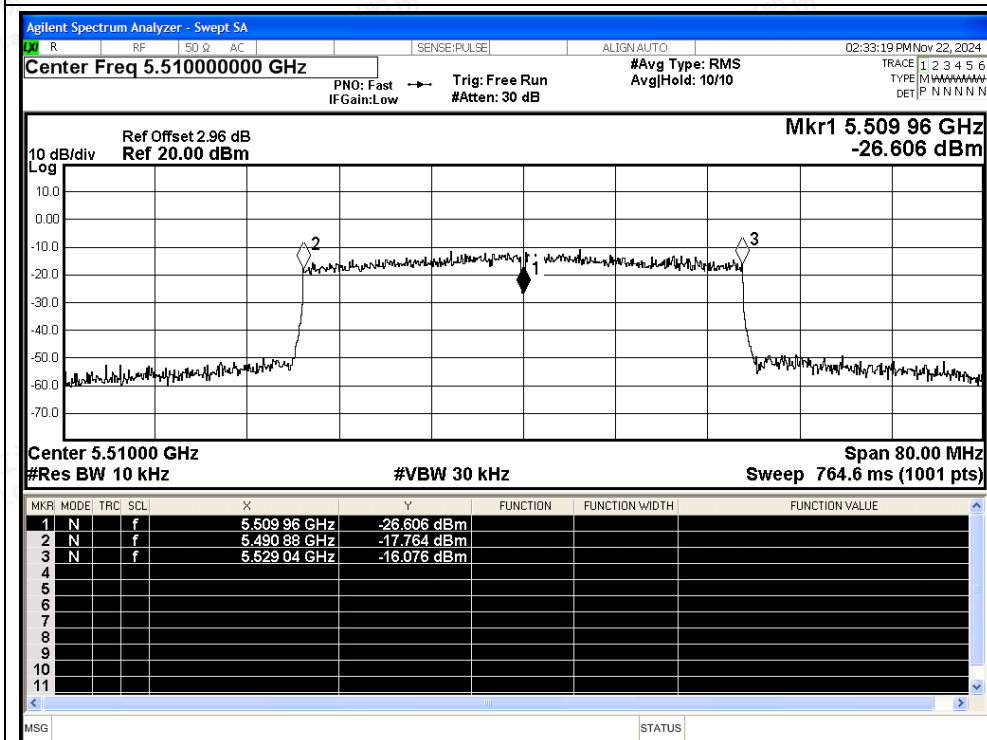

Freq. Stability NVNT ax40 5550MHz Ant7

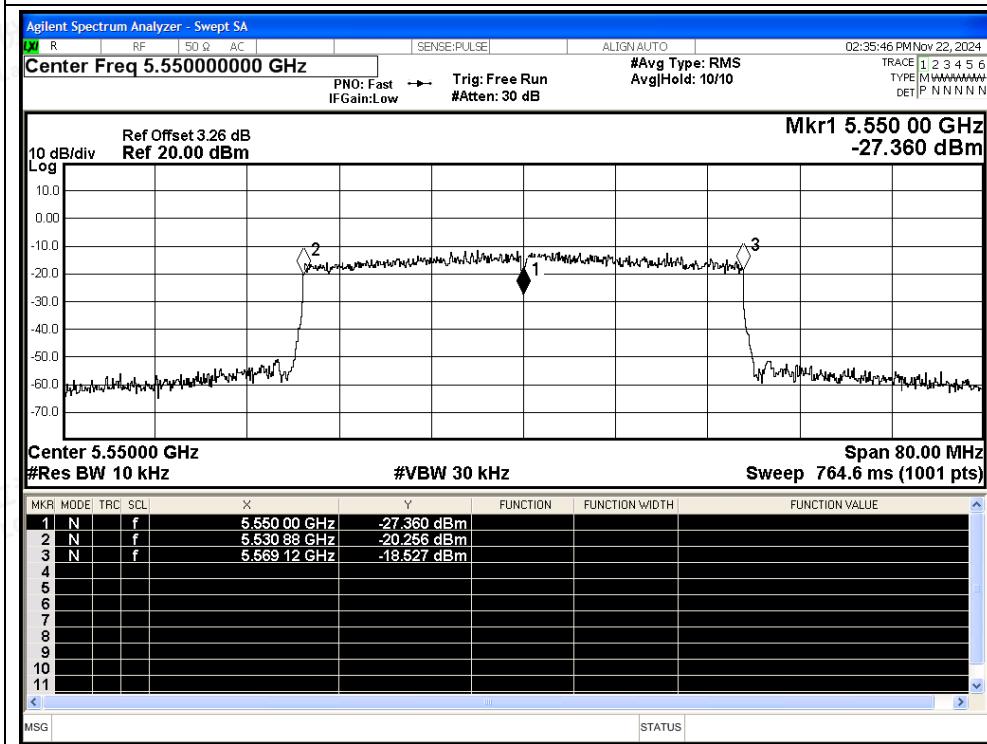

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Freq. Stability NVNT ax40 5670MHz Ant7

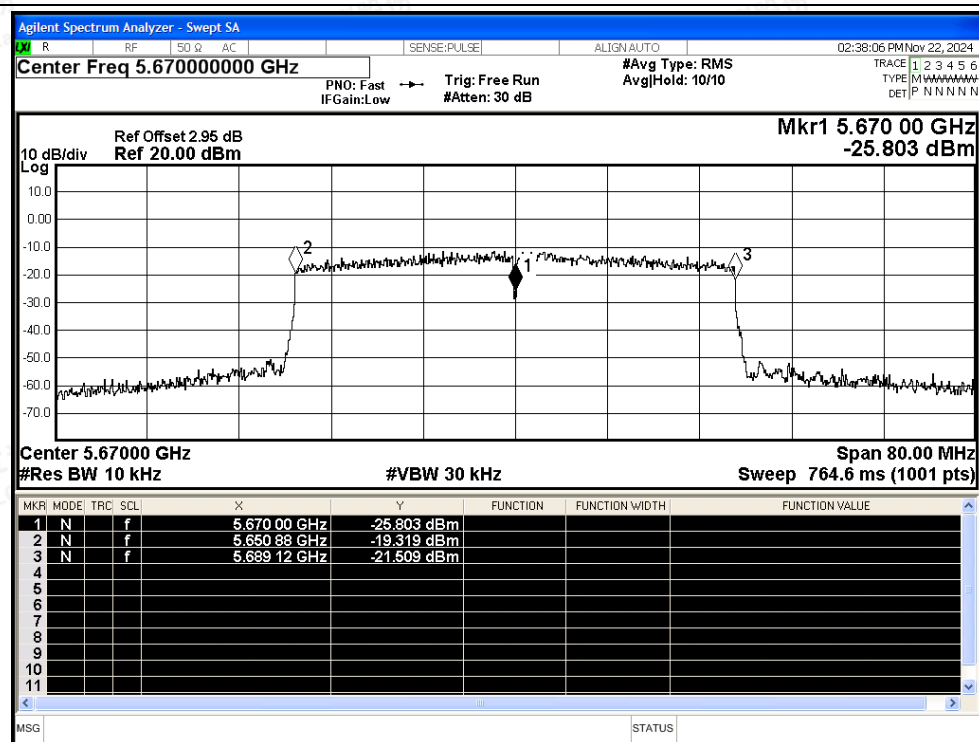

Freq. Stability NVNT ax80 5530MHz Ant7

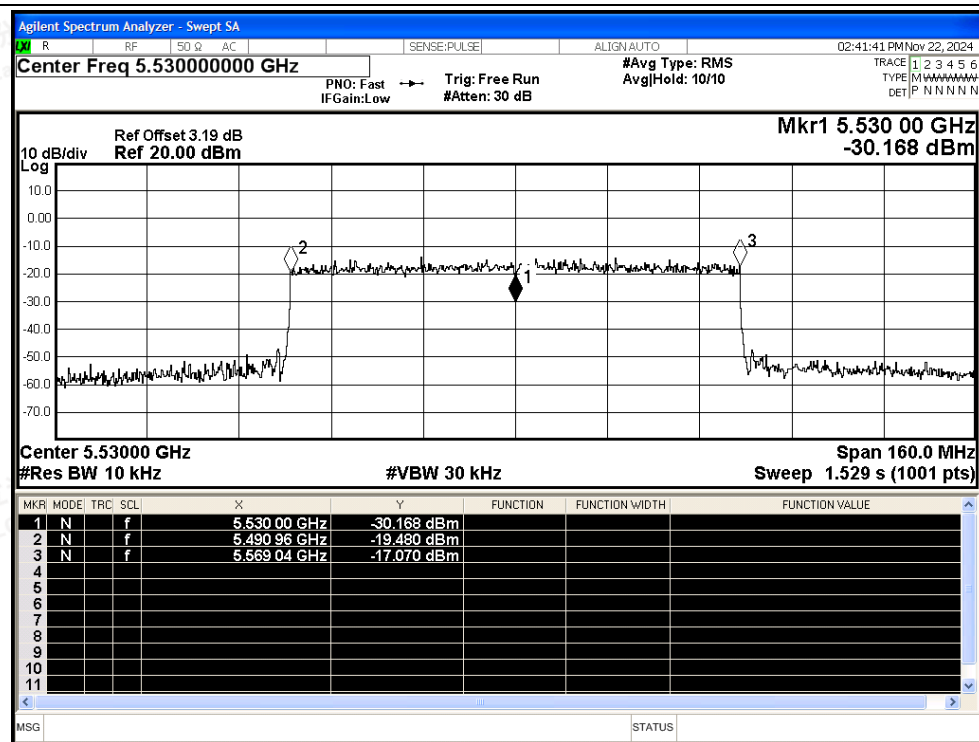


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

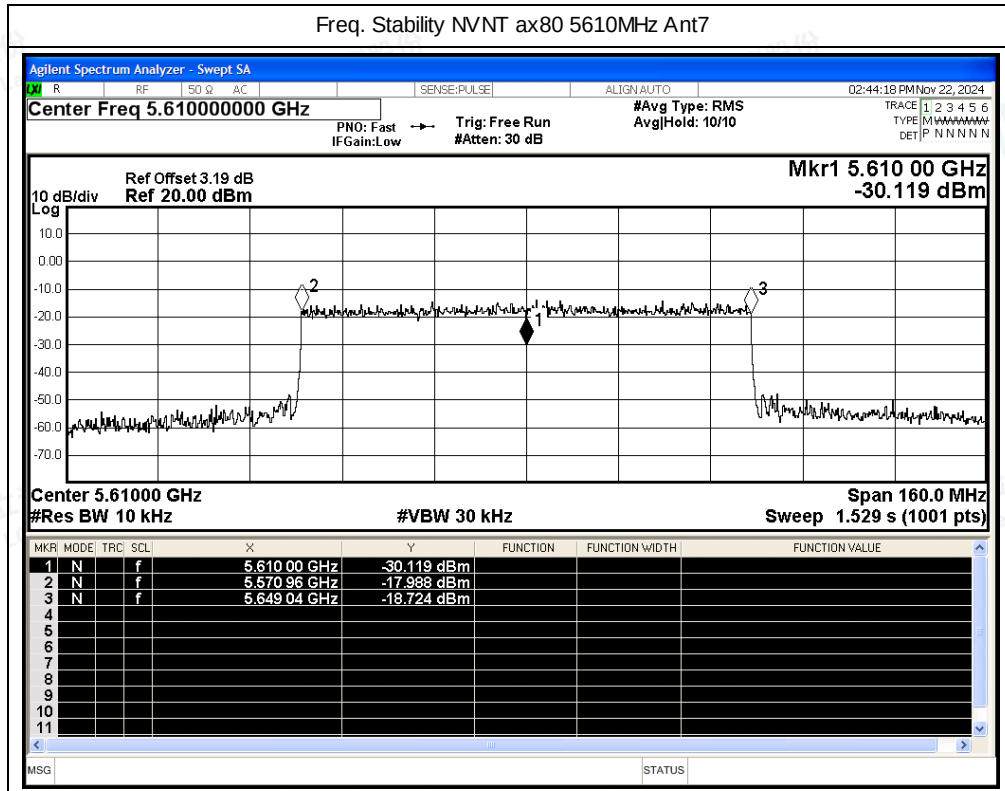

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity



F.6 Duty Cycle


Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant6	58.5	2.33	0.72
NVNT	a	5580	Ant6	58.5	2.33	0.72
NVNT	a	5700	Ant6	58.46	2.33	0.72
NVNT	n20	5500	Ant6	58.21	2.35	0.77
NVNT	n20	5580	Ant6	56.79	2.46	0.77
NVNT	n20	5700	Ant6	56.84	2.45	0.77
NVNT	n40	5510	Ant6	55.72	2.54	0.81
NVNT	n40	5550	Ant6	55.9	2.53	0.81
NVNT	n40	5670	Ant6	55.01	2.6	0.81
NVNT	ac20	5500	Ant6	55.42	2.56	0.76
NVNT	ac20	5580	Ant6	57.17	2.43	0.76
NVNT	ac20	5700	Ant6	56.94	2.45	0.76
NVNT	ac40	5510	Ant6	55.09	2.59	0.8
NVNT	ac40	5550	Ant6	55.09	2.59	0.8
NVNT	ac40	5670	Ant6	55.31	2.57	0.8
NVNT	ac80	5530	Ant6	37.2	4.29	1.68
NVNT	ac80	5610	Ant6	37.2	4.29	1.68
NVNT	ax20	5500	Ant6	65.73	1.82	0.51
NVNT	ax20	5580	Ant6	65.73	1.82	0.51
NVNT	ax20	5700	Ant6	65.73	1.82	0.51
NVNT	ax40	5510	Ant6	49.83	3.03	1
NVNT	ax40	5550	Ant6	49.65	3.04	1
NVNT	ax40	5670	Ant6	48.1	3.18	1
NVNT	ax80	5530	Ant6	33.12	4.8	1.97
NVNT	ax80	5610	Ant6	31.57	5.01	1.98






Test Graphs

Duty Cycle NVNT a 5500MHz Ant6

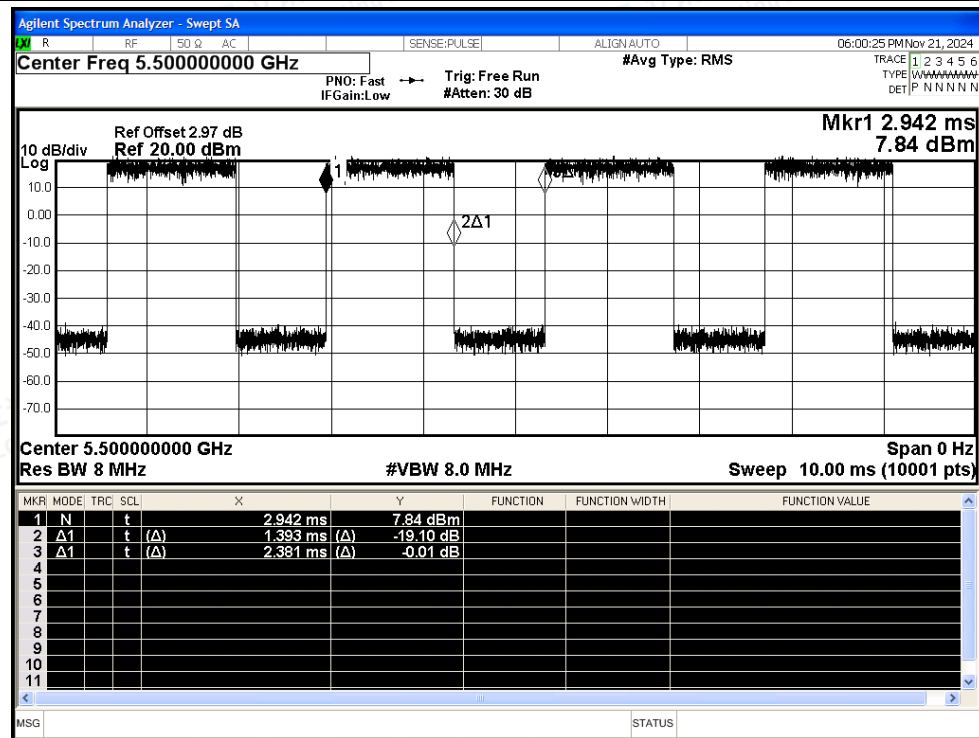

Duty Cycle NVNT a 5580MHz Ant6

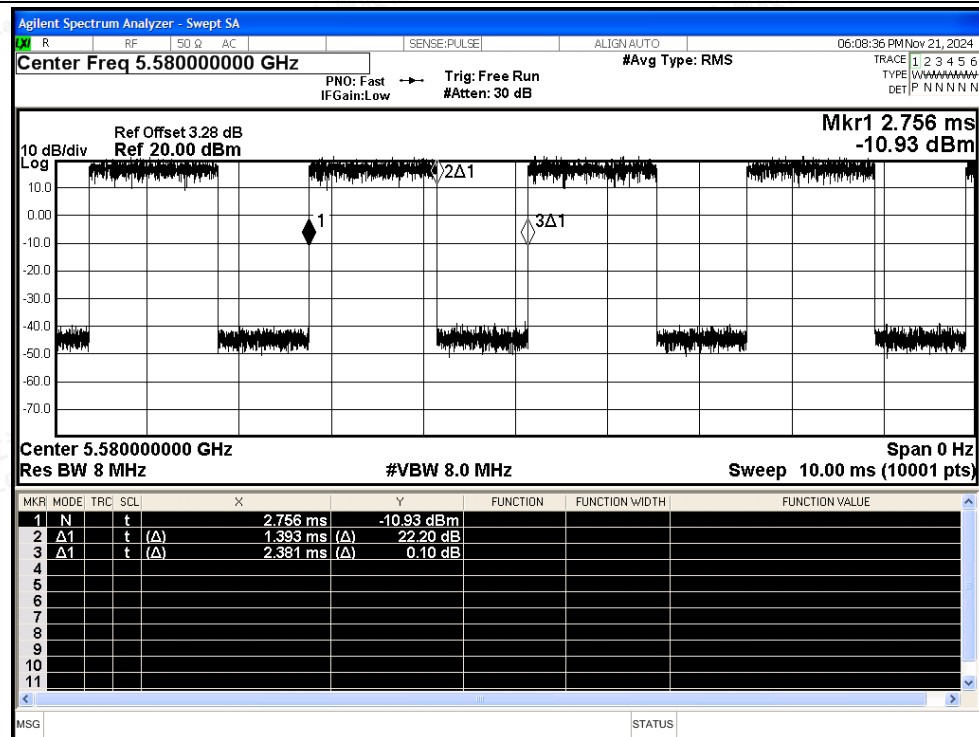

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant6

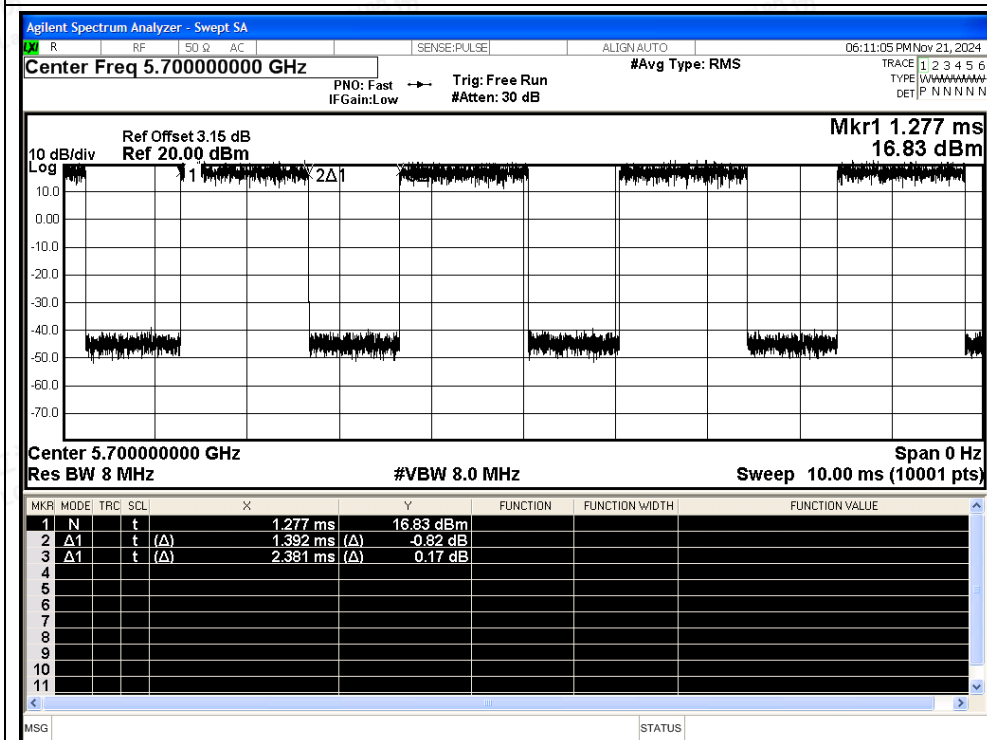


Duty Cycle NVNT n20 5500MHz Ant6

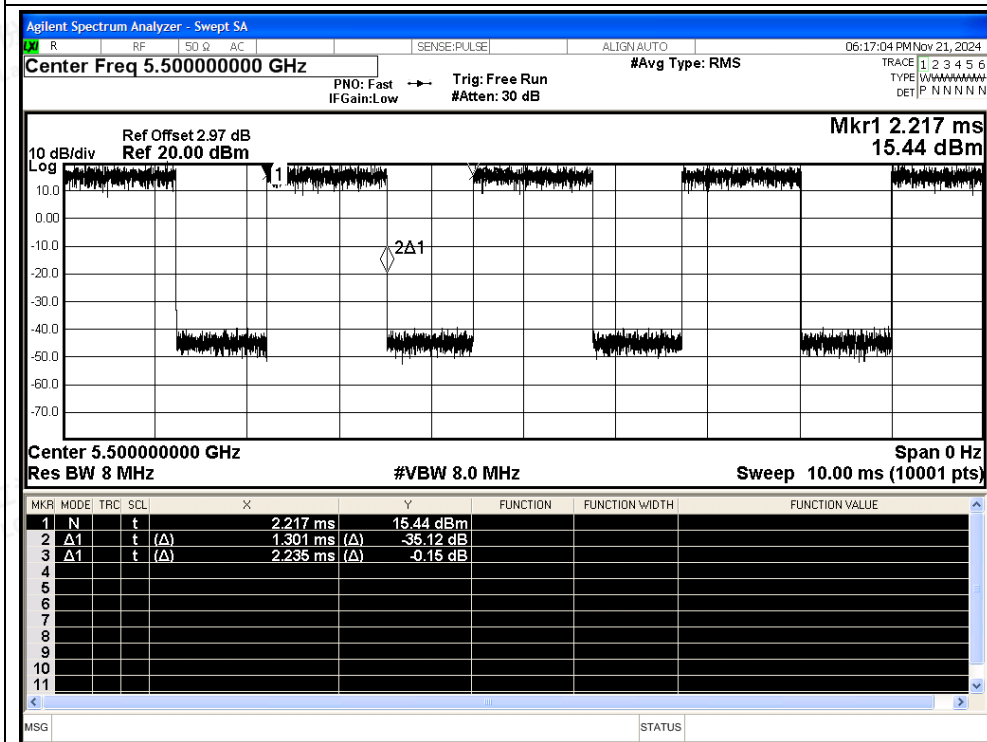




Duty Cycle NVNT n20 5580MHz Ant6

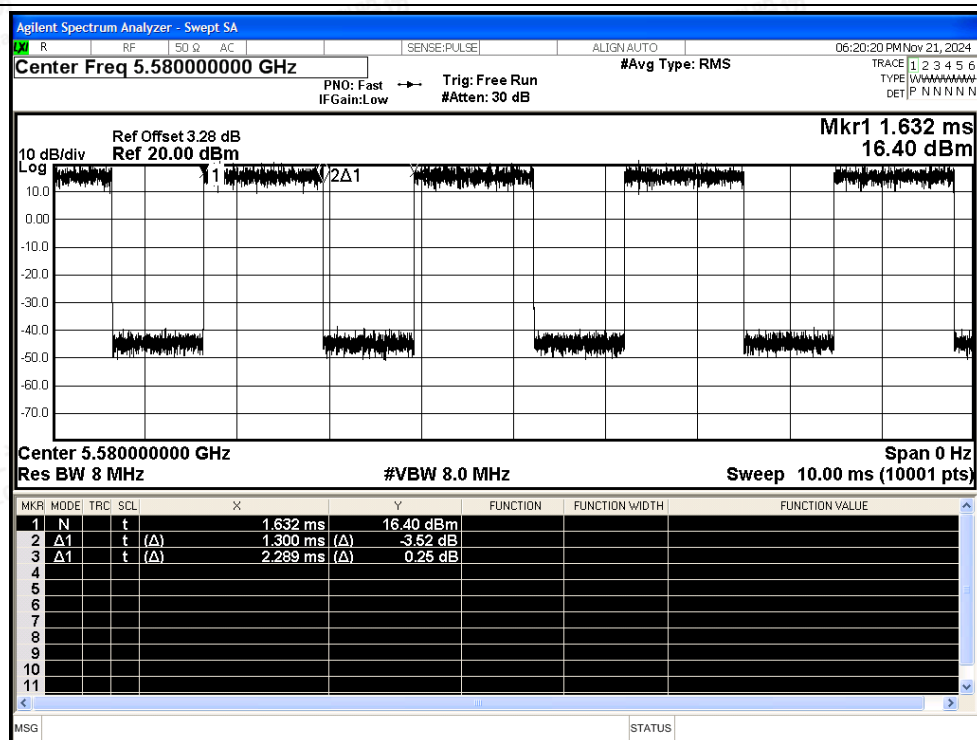

Duty Cycle NVNT n20 5700MHz Ant6

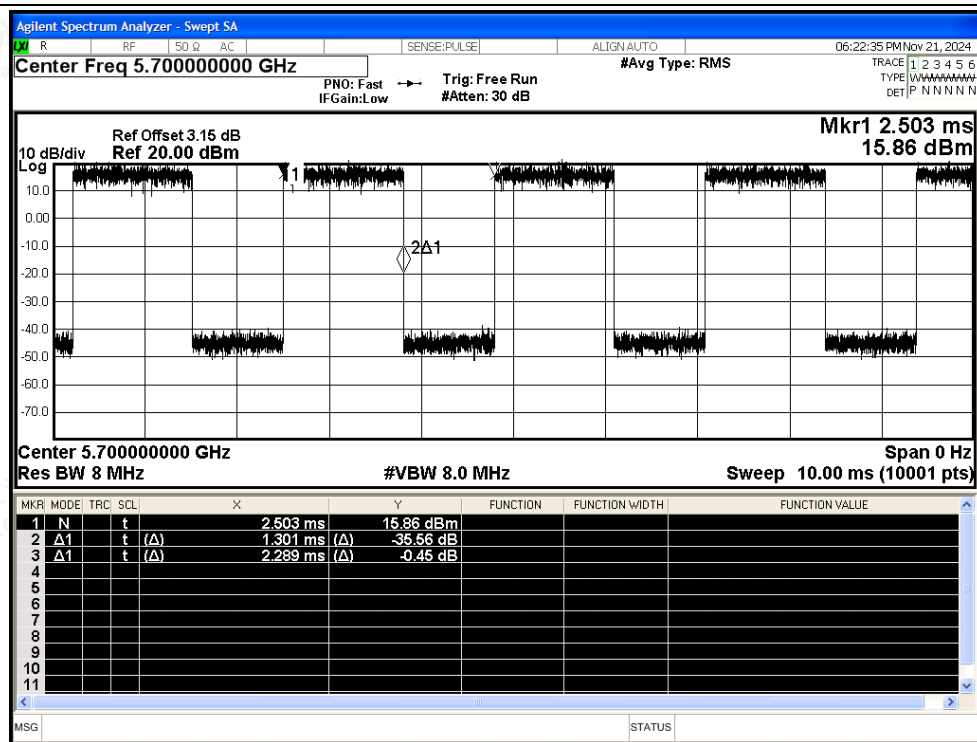

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant6

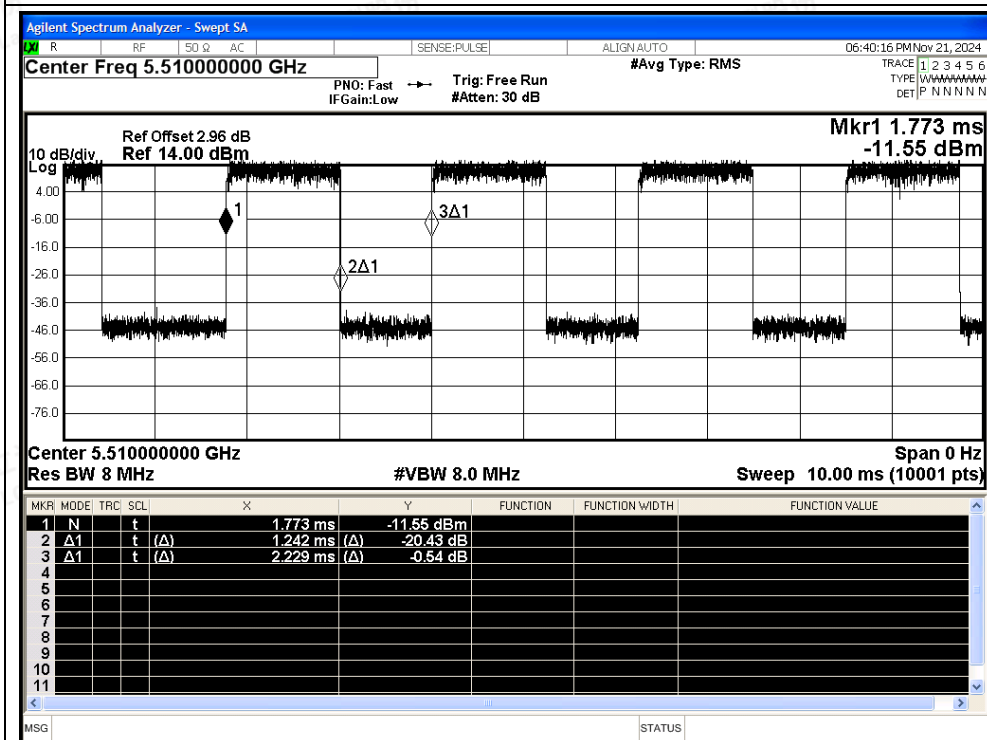

Duty Cycle NVNT n40 5550MHz Ant6

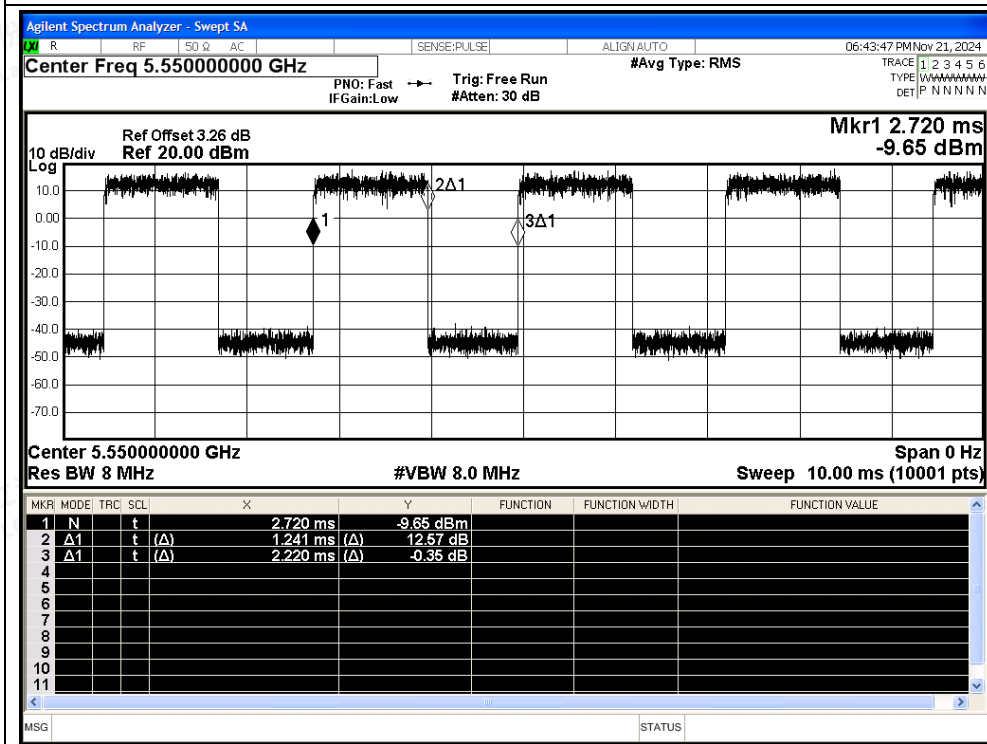

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant6

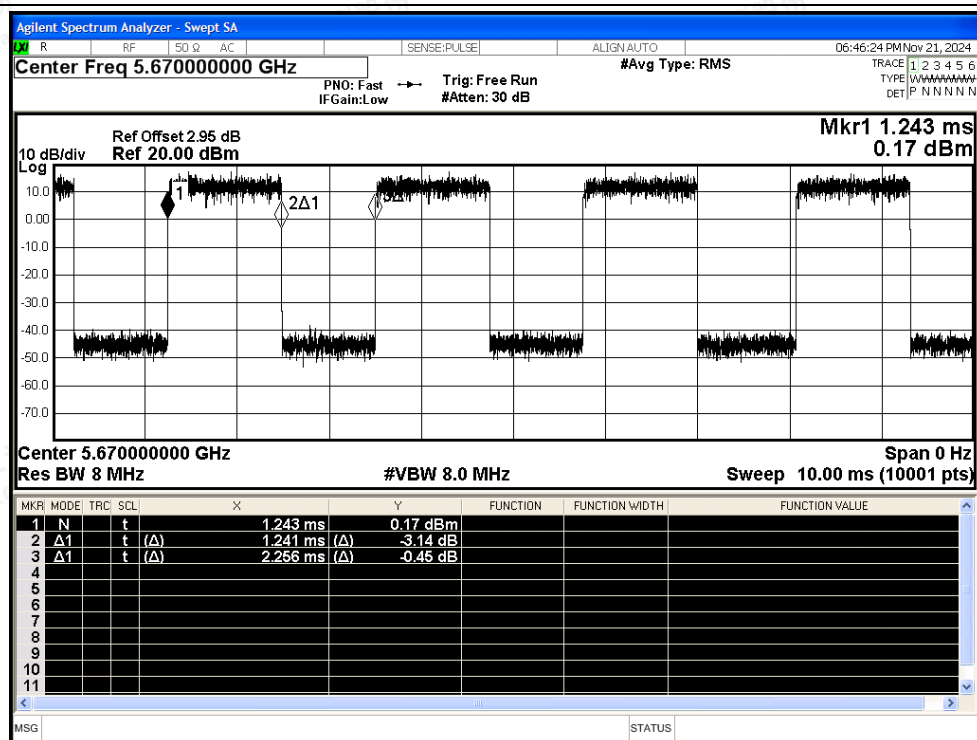

Duty Cycle NVNT ac20 5500MHz Ant6

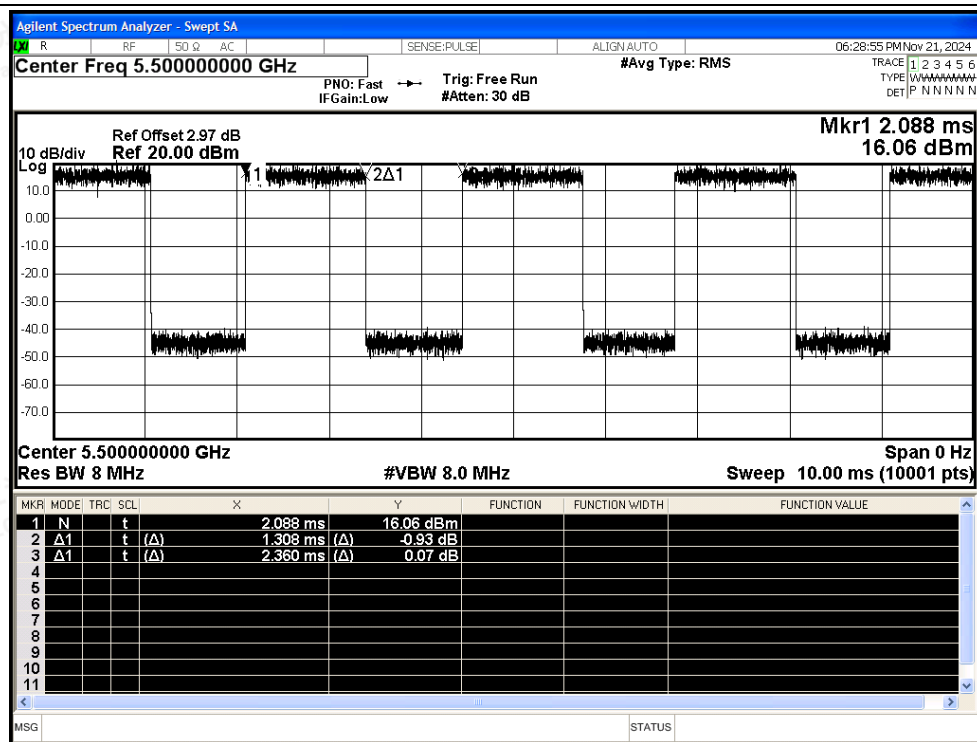

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant6

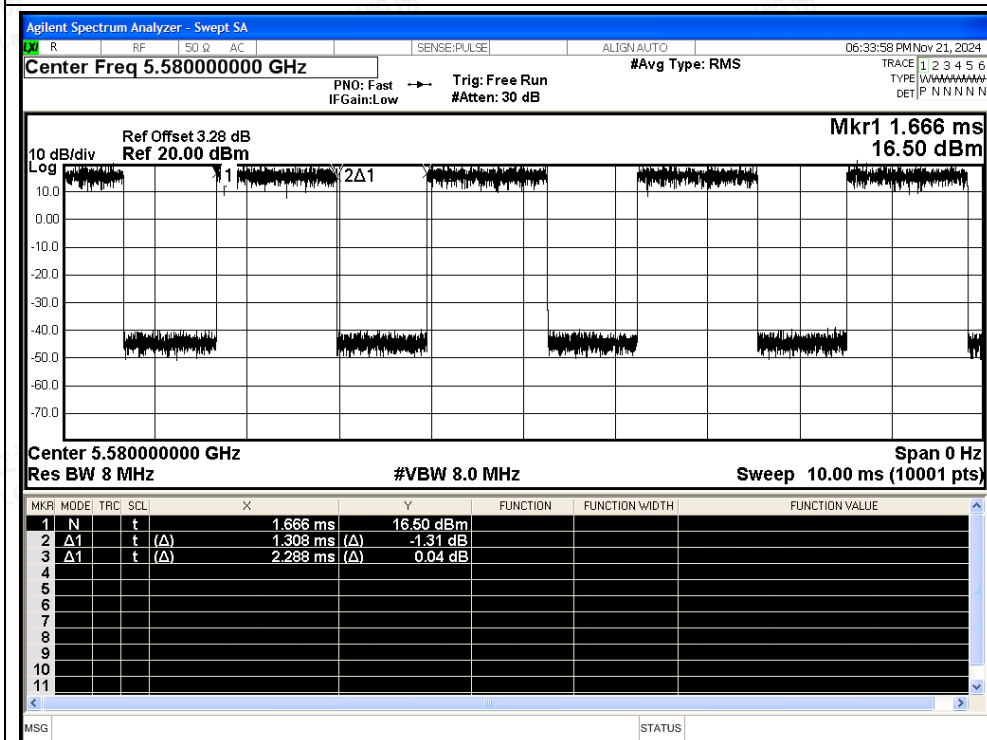

Duty Cycle NVNT ac20 5700MHz Ant6

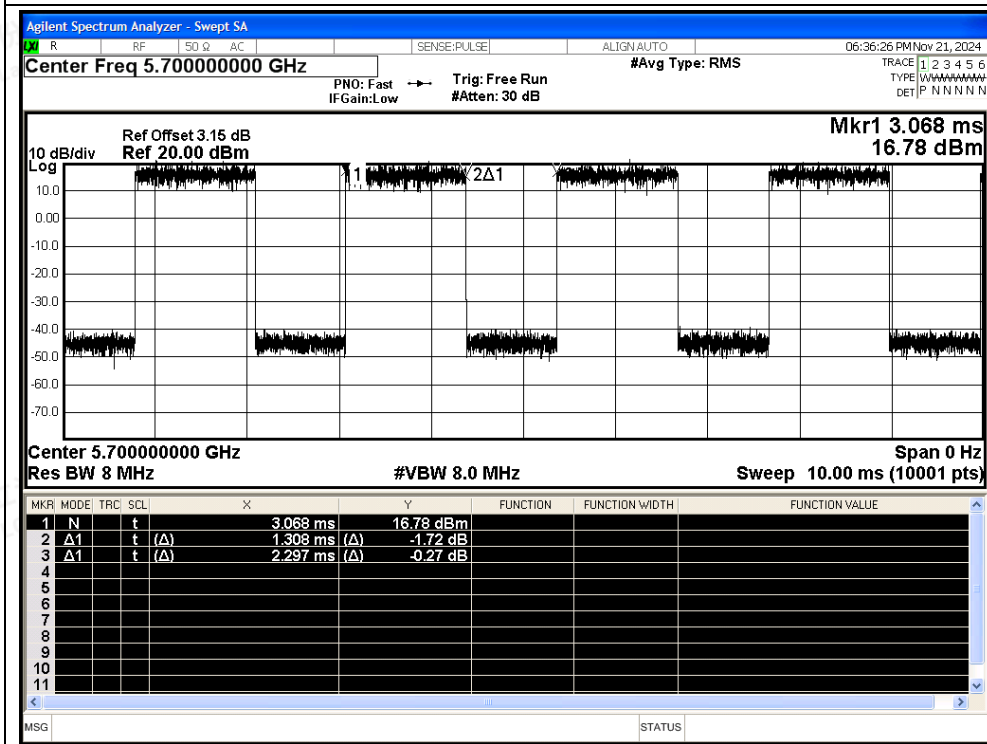

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant6

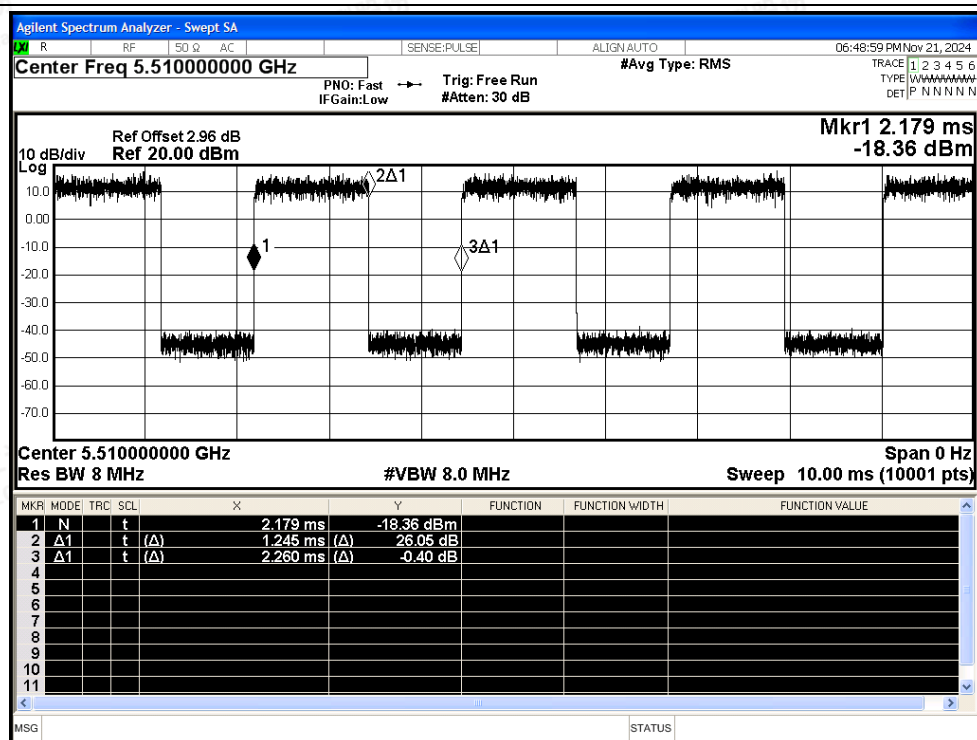

Duty Cycle NVNT ac40 5550MHz Ant6

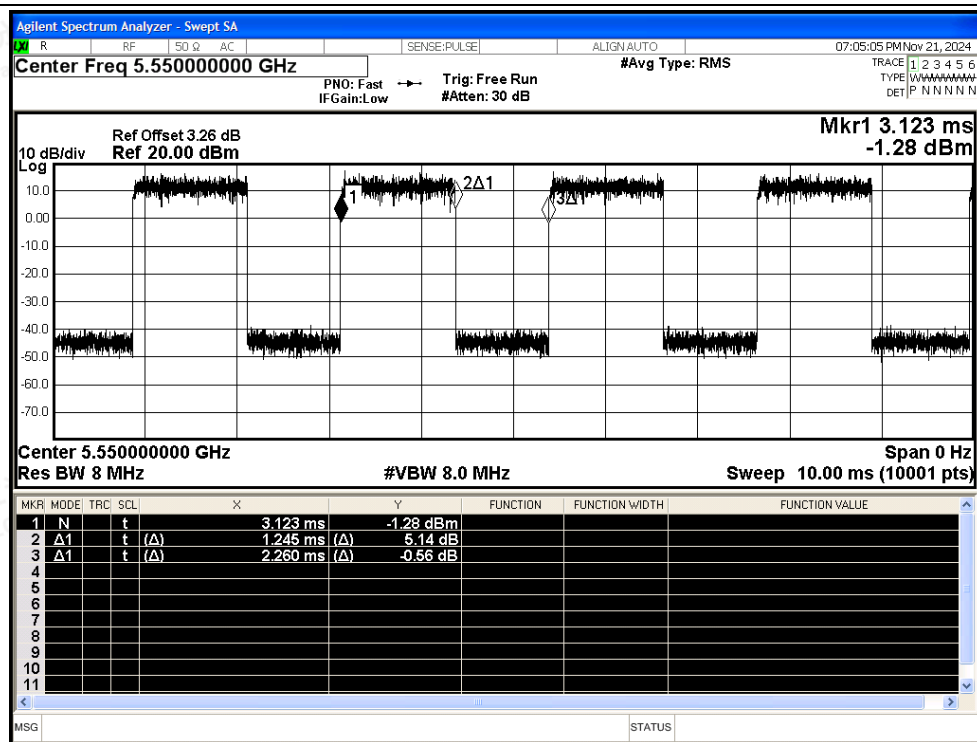

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant6

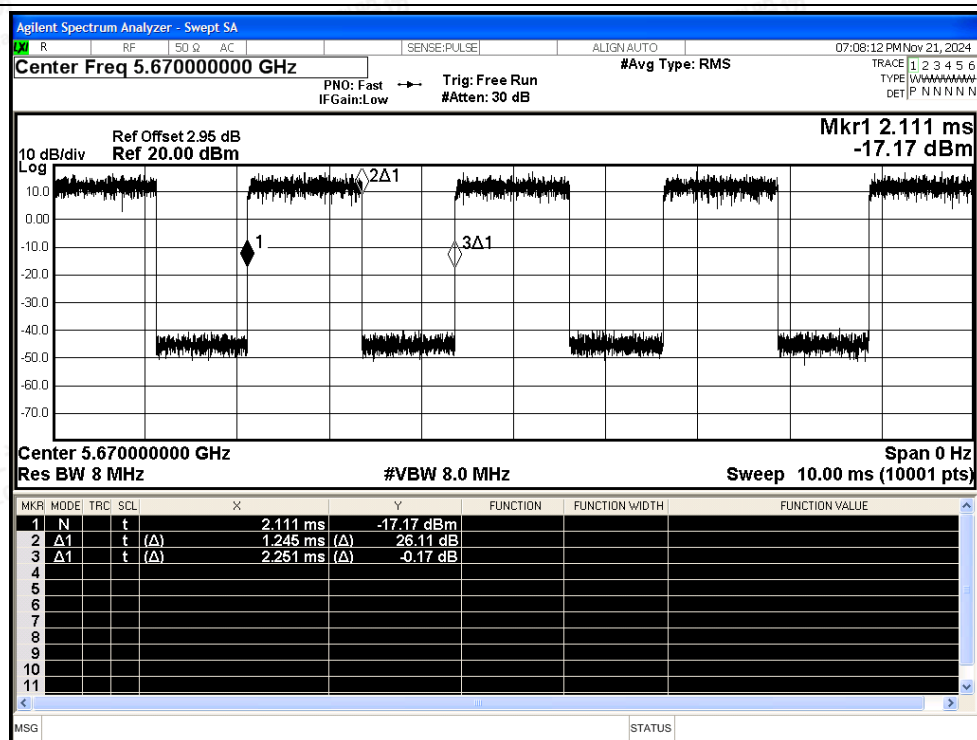

Duty Cycle NVNT ac80 5530MHz Ant6

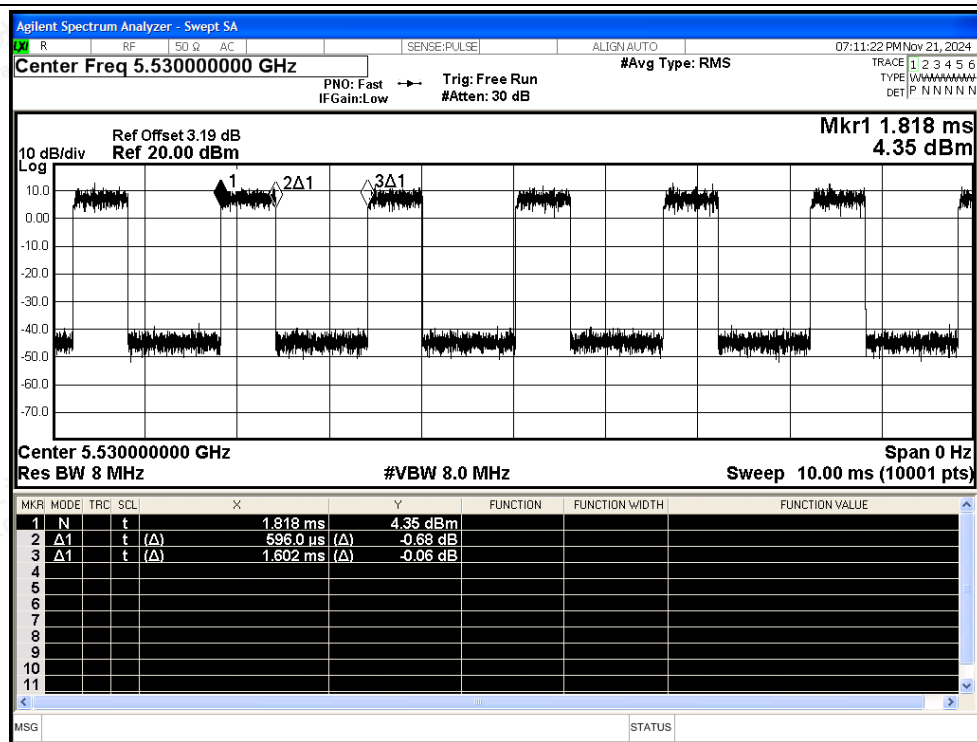

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac80 5610MHz Ant6

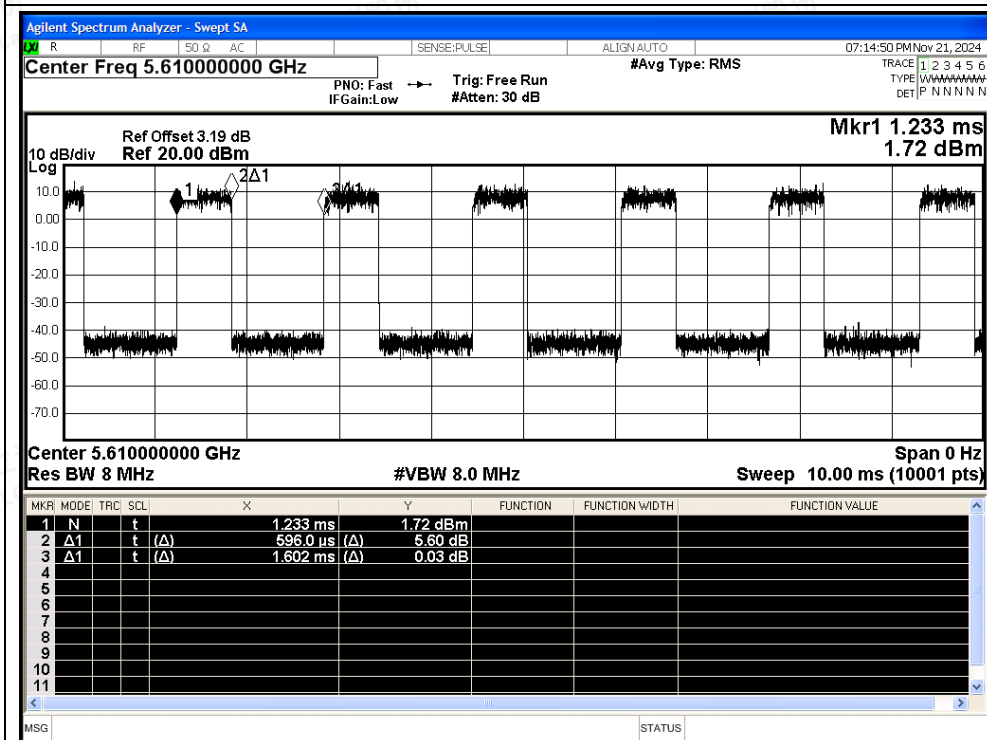

Duty Cycle NVNT ax20 5500MHz Ant6

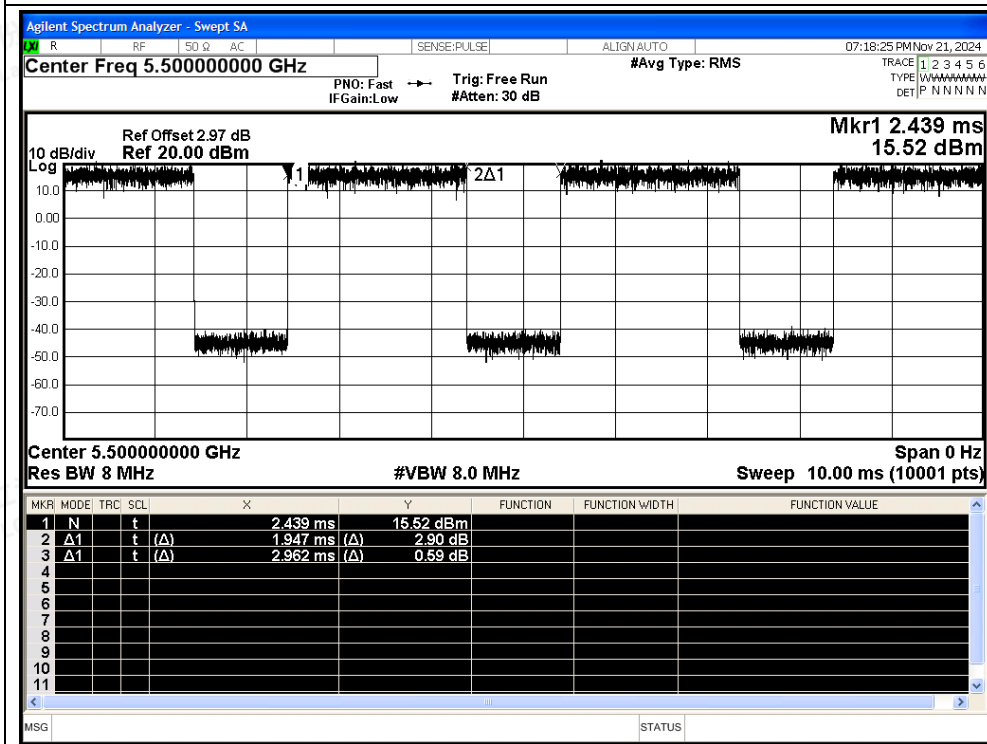

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5580MHz Ant6

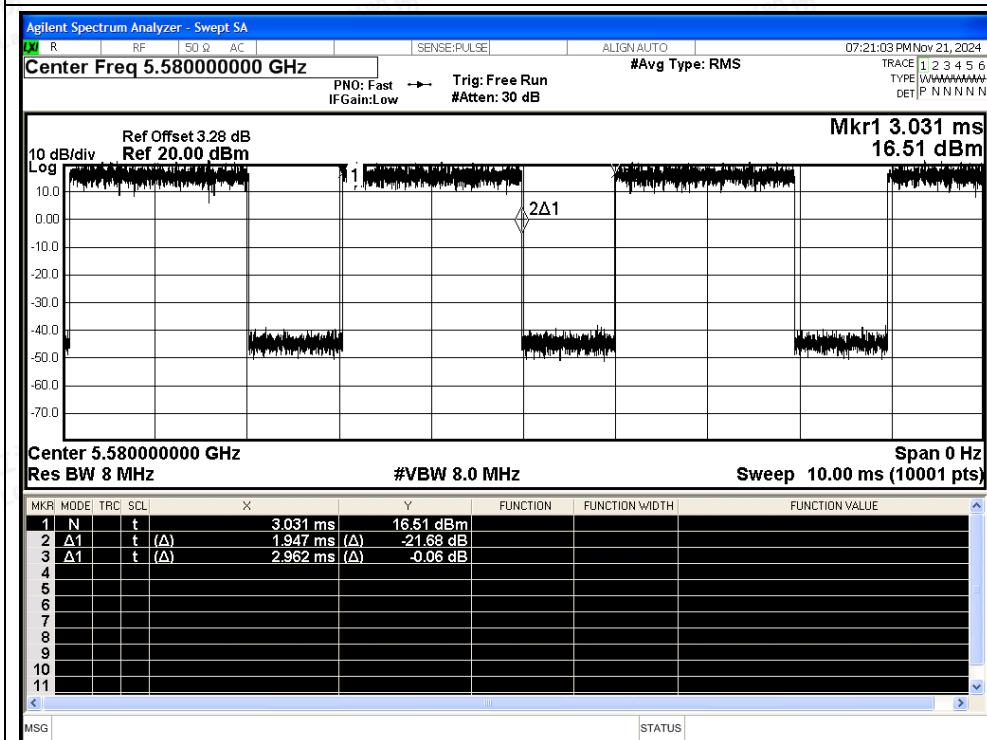

Duty Cycle NVNT ax20 5700MHz Ant6

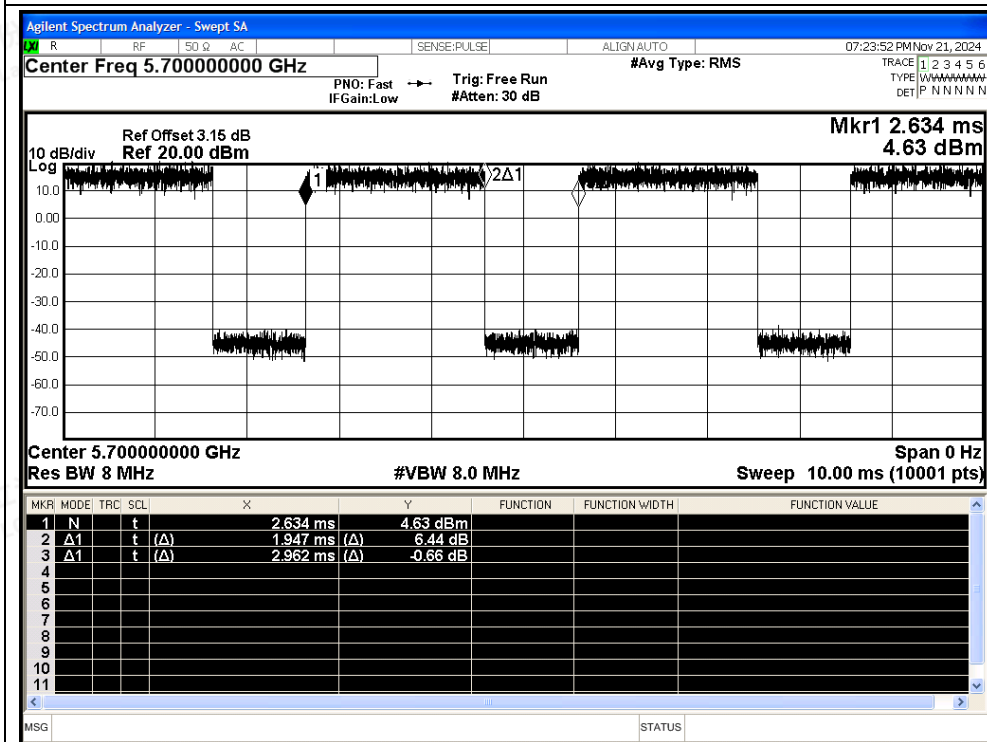

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5510MHz Ant6

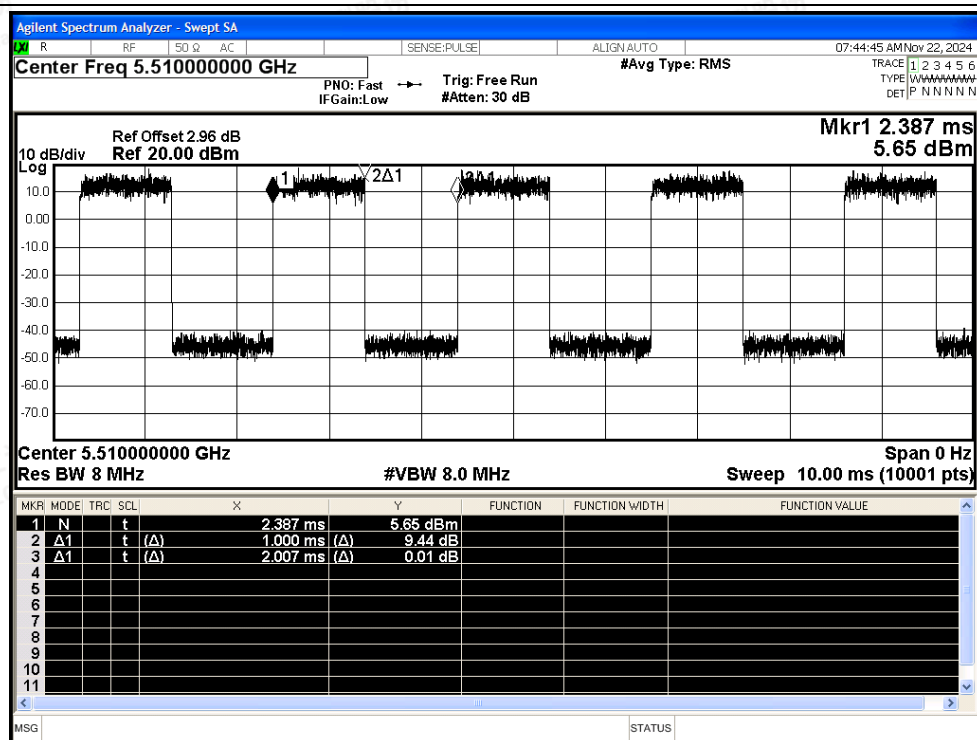

Duty Cycle NVNT ax40 5550MHz Ant6

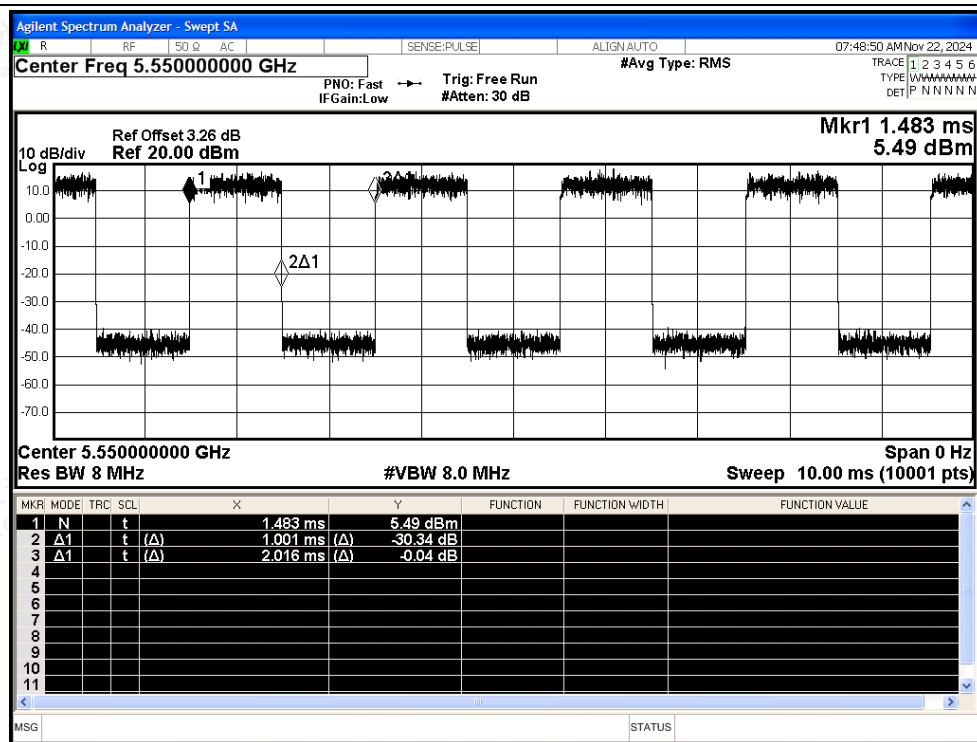

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5670MHz Ant6

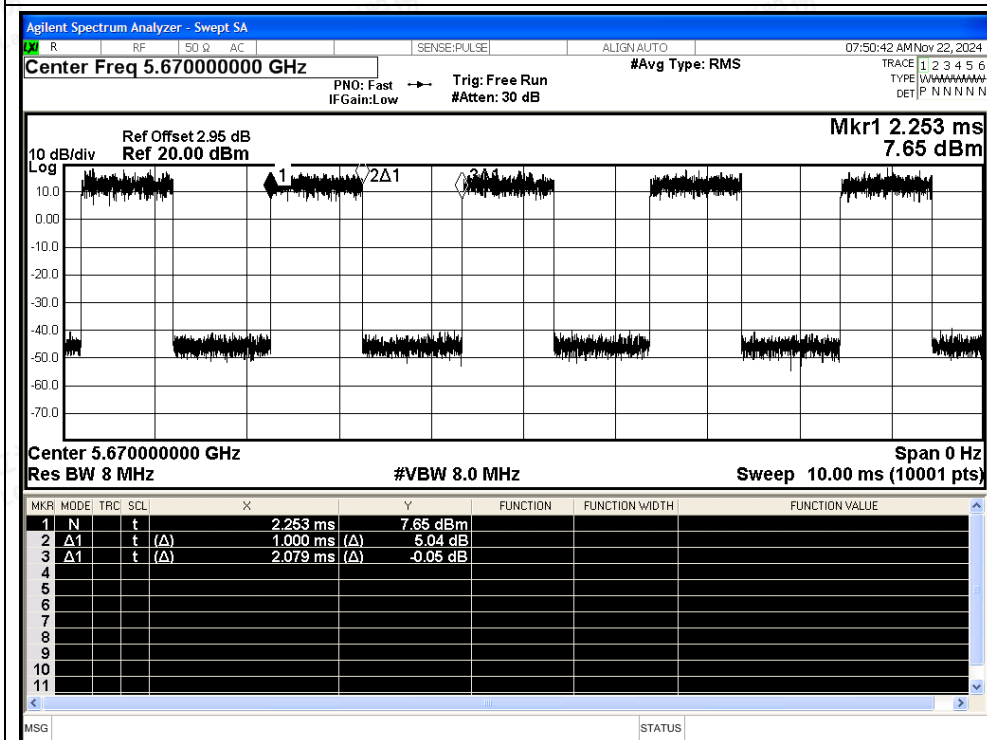

Duty Cycle NVNT ax80 5530MHz Ant6

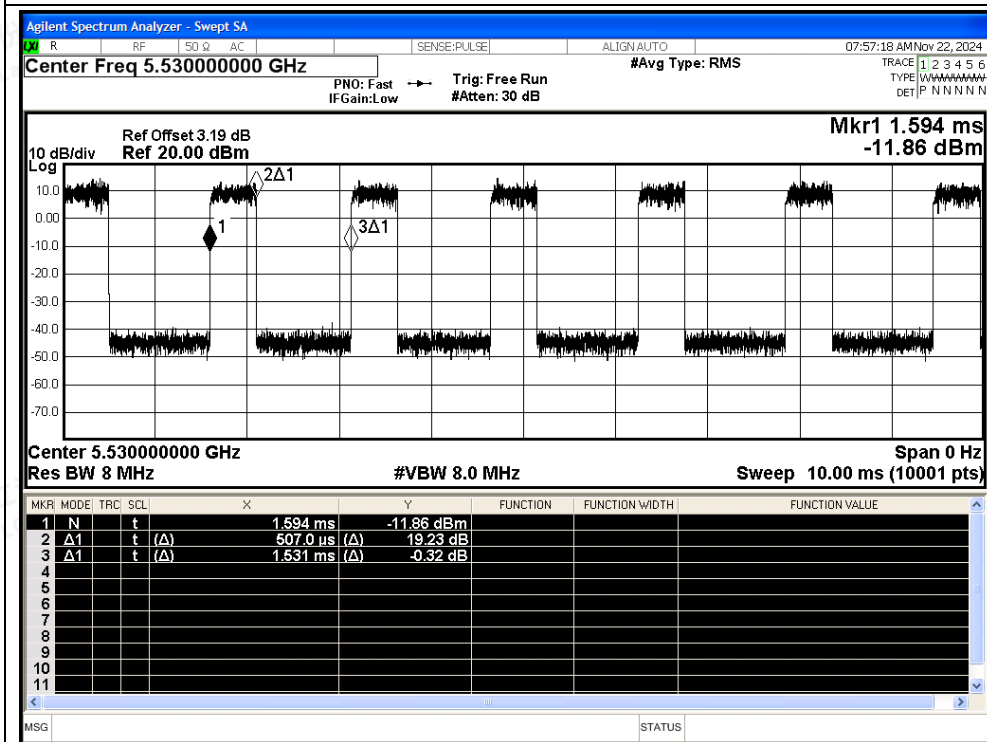


Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

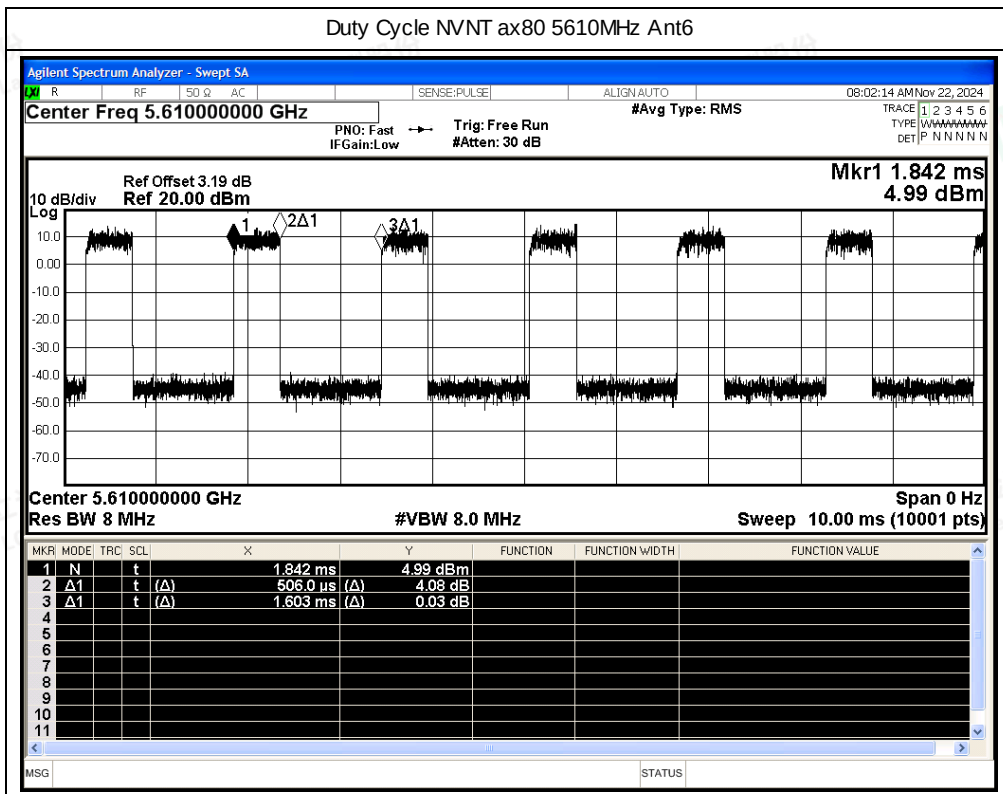




Condition	Mode	Frequency (MHz)	Antenna	Duty Cycle (%)	Correction Factor (dB)	1/T (kHz)
NVNT	a	5500	Ant7	59.18	2.28	0.72
NVNT	a	5580	Ant7	59.18	2.28	0.72
NVNT	a	5700	Ant7	57	2.44	0.72
NVNT	n20	5500	Ant7	57.06	2.44	0.77
NVNT	n20	5580	Ant7	56.79	2.46	0.77
NVNT	n20	5700	Ant7	55.06	2.59	0.77
NVNT	n40	5510	Ant7	55.27	2.58	0.81
NVNT	n40	5550	Ant7	53.1	2.75	0.81
NVNT	n40	5670	Ant7	55.23	2.58	0.81
NVNT	ac20	5500	Ant7	57.21	2.43	0.76
NVNT	ac20	5580	Ant7	56.99	2.44	0.76
NVNT	ac20	5700	Ant7	55	2.6	0.76
NVNT	ac40	5510	Ant7	51.55	2.88	0.8
NVNT	ac40	5550	Ant7	53.18	2.74	0.8
NVNT	ac40	5670	Ant7	55.26	2.58	0.8
NVNT	ac80	5530	Ant7	37.63	4.24	1.68
NVNT	ac80	5610	Ant7	35.22	4.53	1.68
NVNT	ax20	5500	Ant7	48.47	3.15	0.99
NVNT	ax20	5580	Ant7	50.65	2.95	0.99
NVNT	ax20	5700	Ant7	49.98	3.01	0.99
NVNT	ax40	5510	Ant7	49.83	3.03	1
NVNT	ax40	5550	Ant7	49.6	3.05	1
NVNT	ax40	5670	Ant7	49.83	3.03	1
NVNT	ax80	5530	Ant7	33.31	4.77	1.97
NVNT	ax80	5610	Ant7	32.92	4.83	1.97






Test Graphs

Duty Cycle NVNT a 5500MHz Ant7

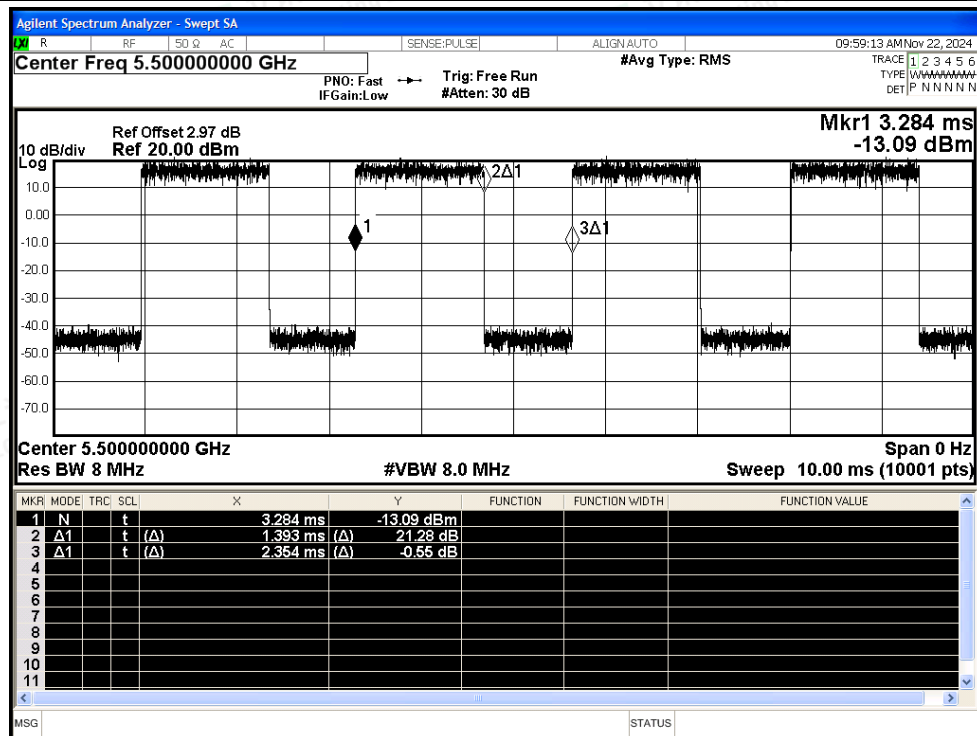

Duty Cycle NVNT a 5580MHz Ant7

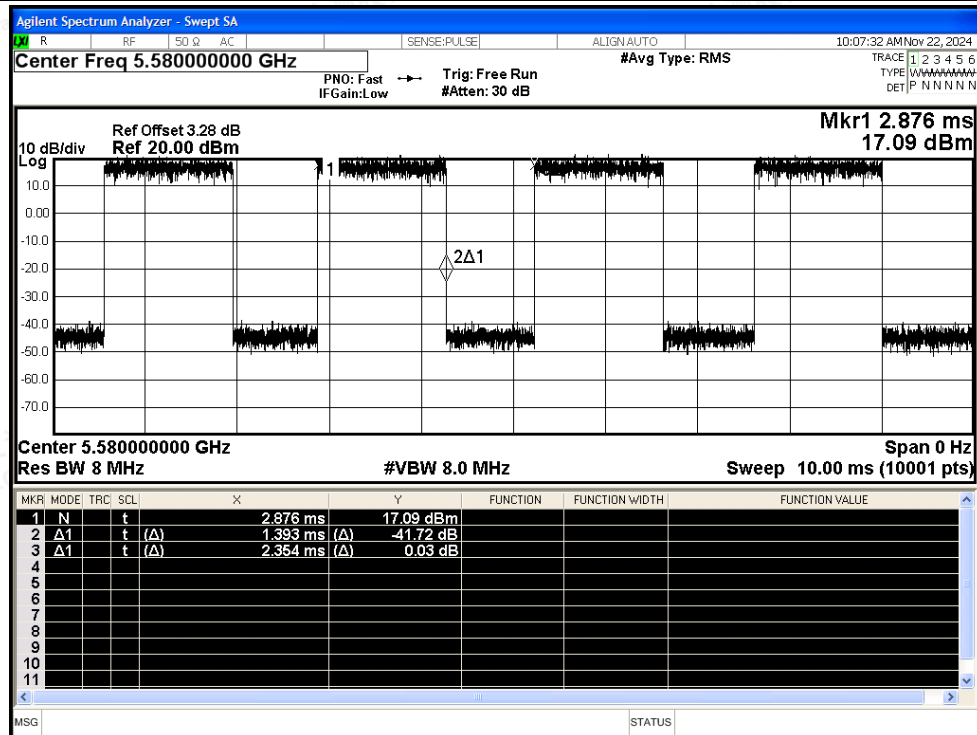

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT a 5700MHz Ant7

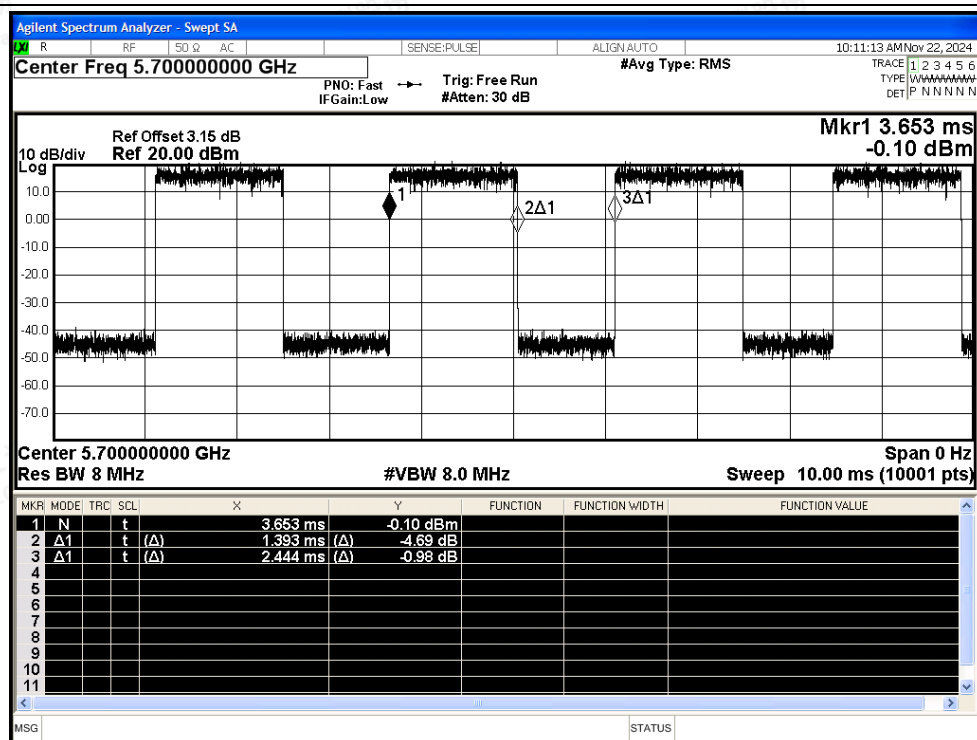

Duty Cycle NVNT n20 5500MHz Ant7

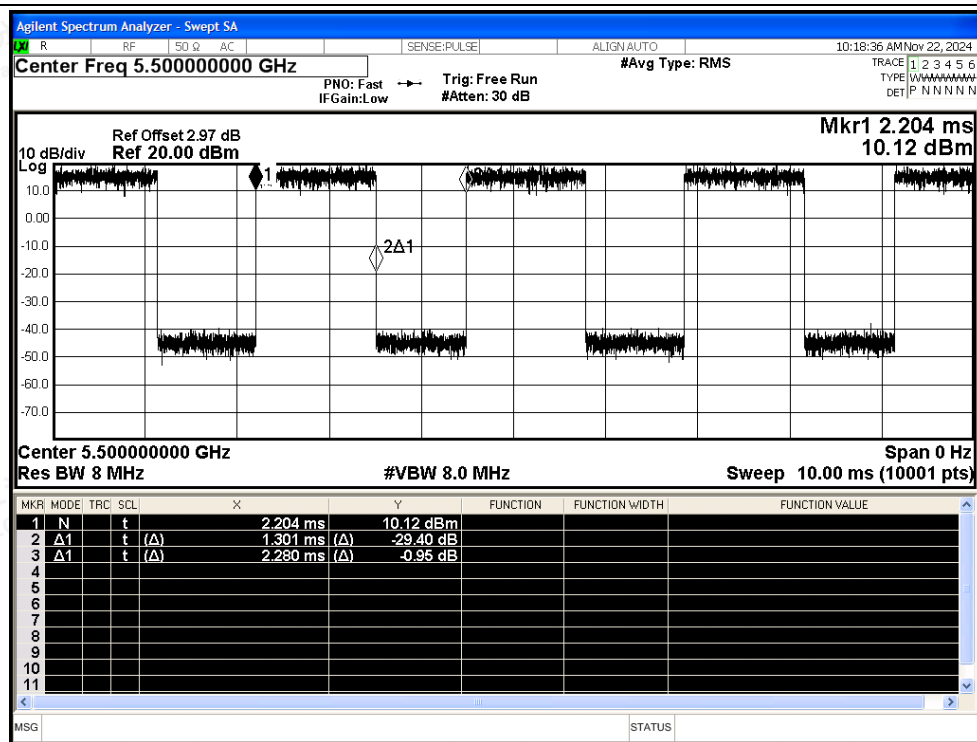

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n20 5580MHz Ant7

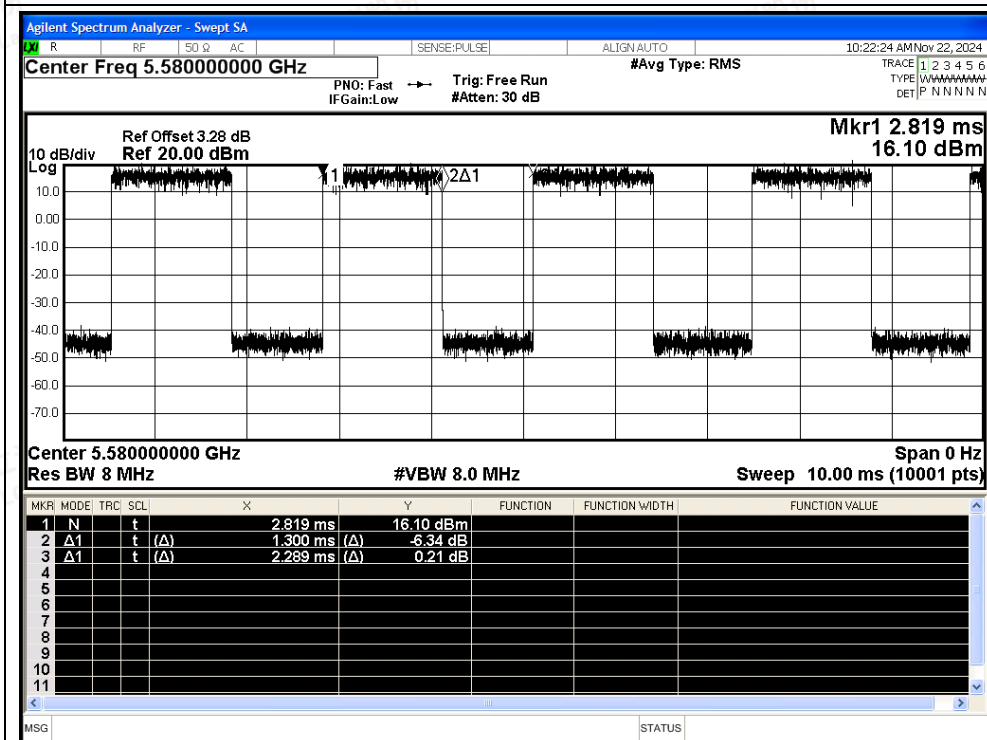

Duty Cycle NVNT n20 5700MHz Ant7

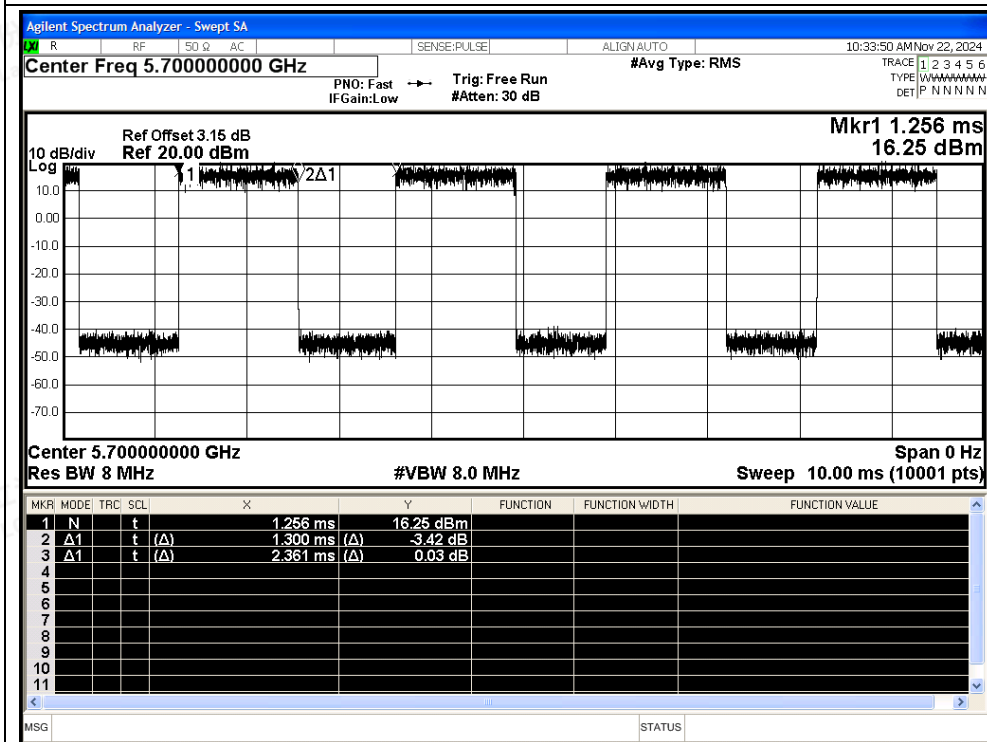

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5510MHz Ant7

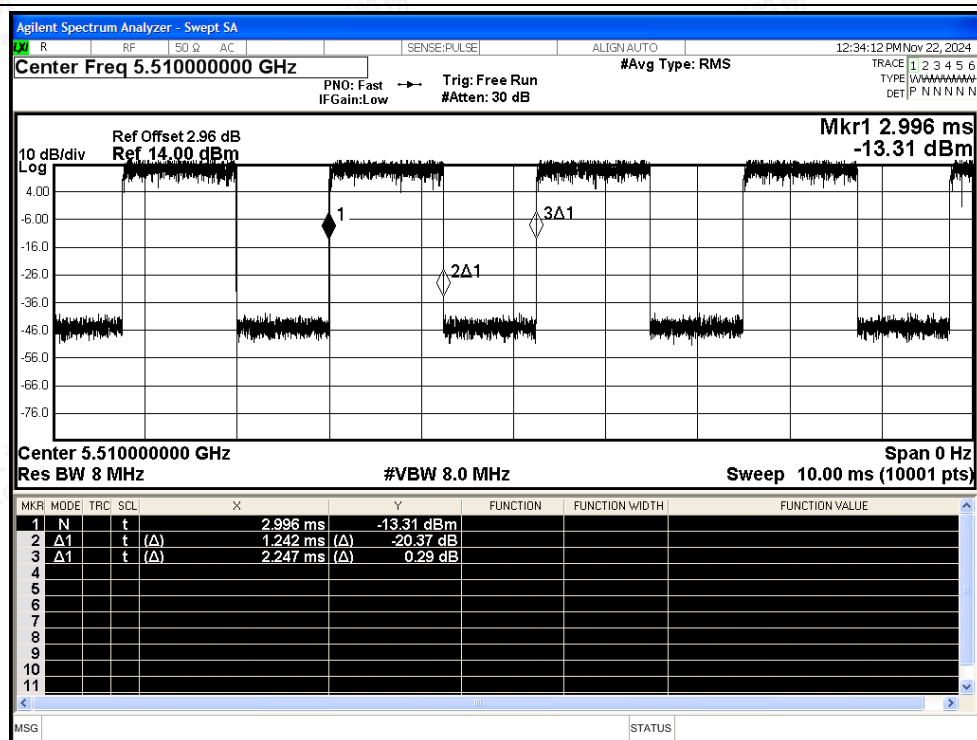

Duty Cycle NVNT n40 5550MHz Ant7

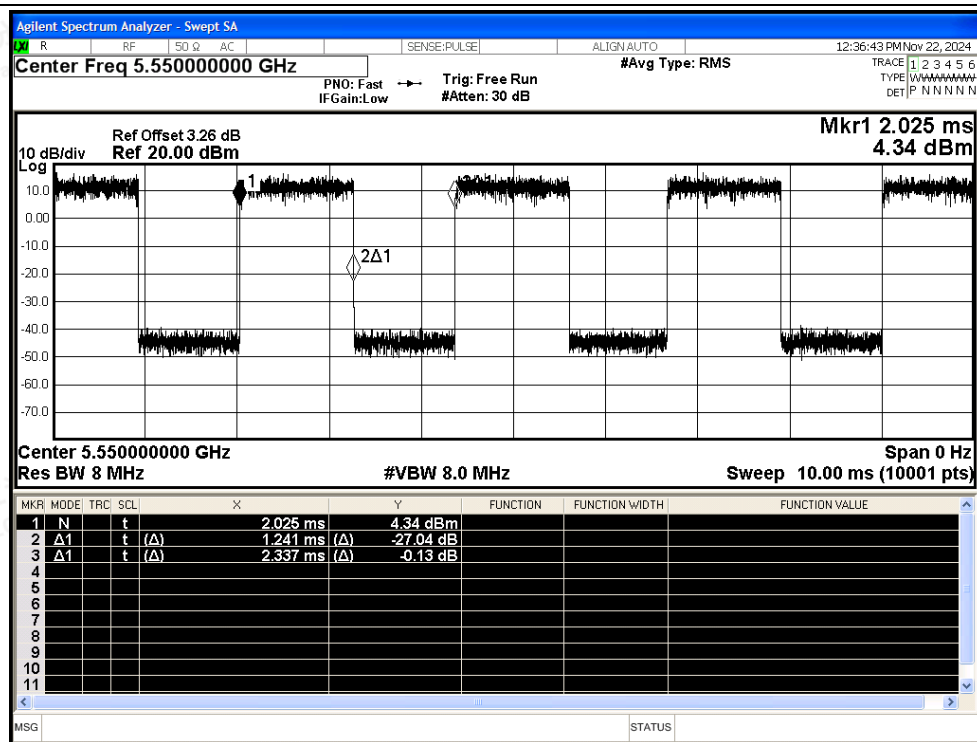

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT n40 5670MHz Ant7

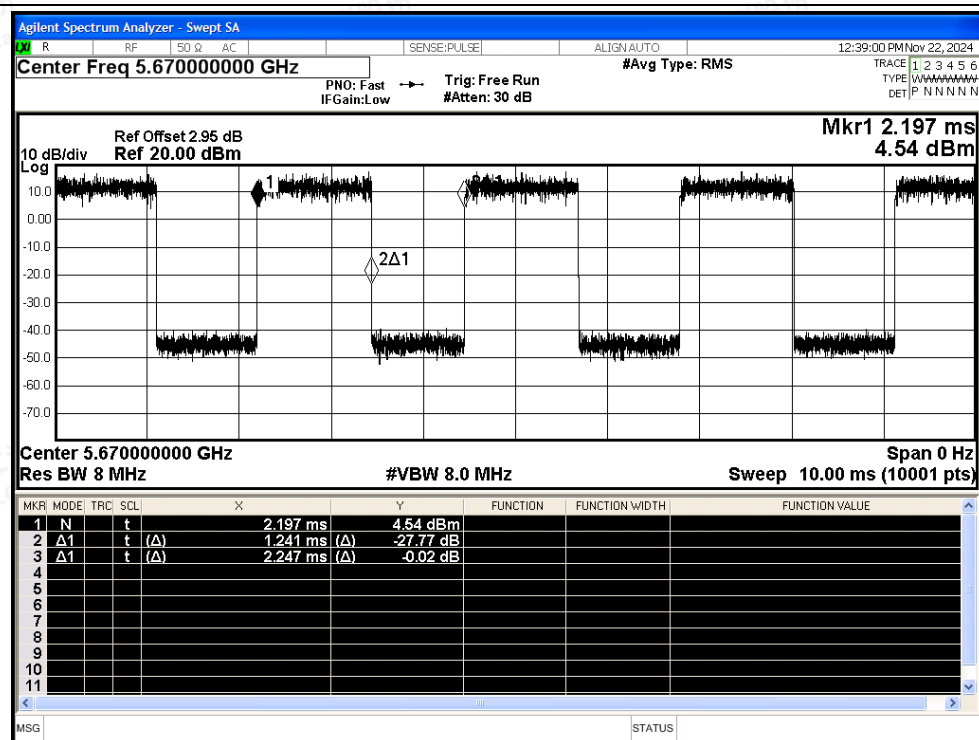

Duty Cycle NVNT ac20 5500MHz Ant7

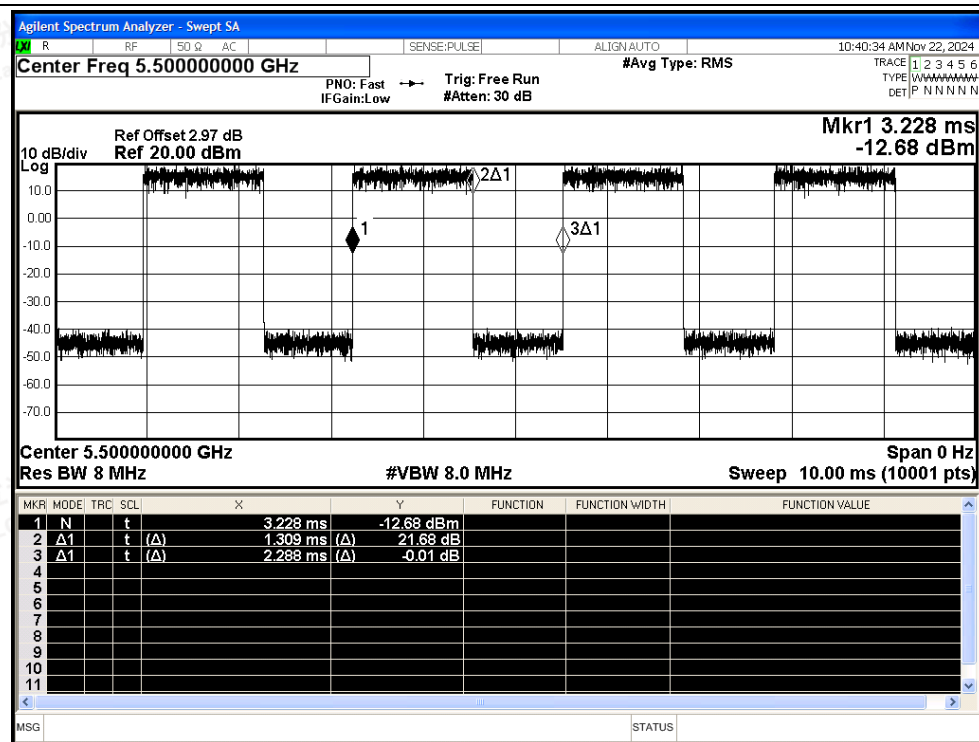

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac20 5580MHz Ant7

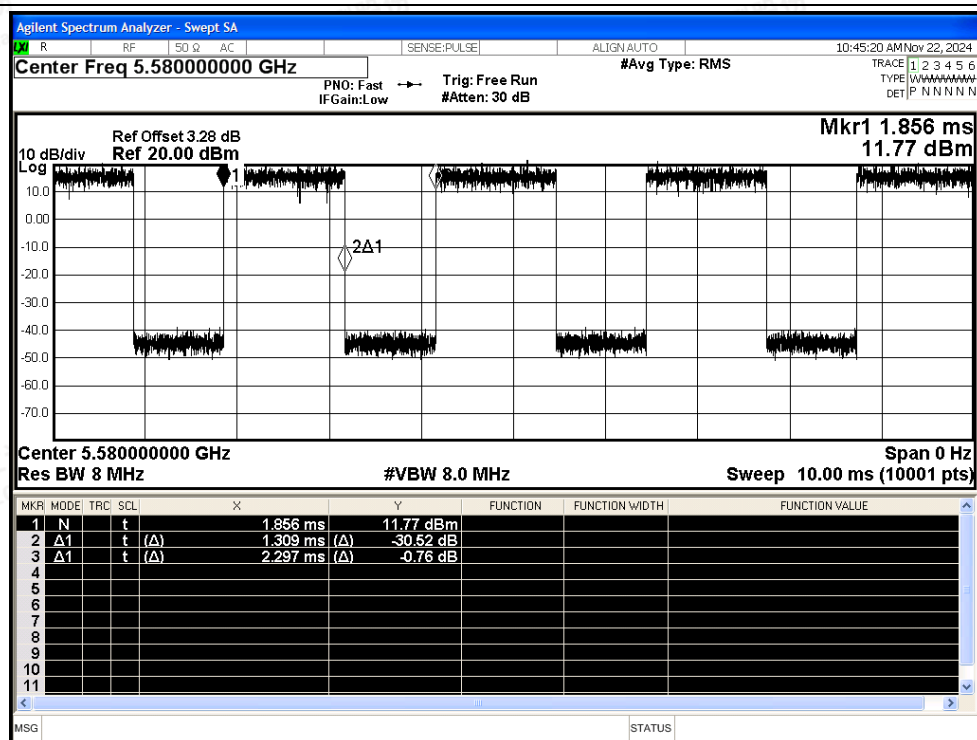

Duty Cycle NVNT ac20 5700MHz Ant7

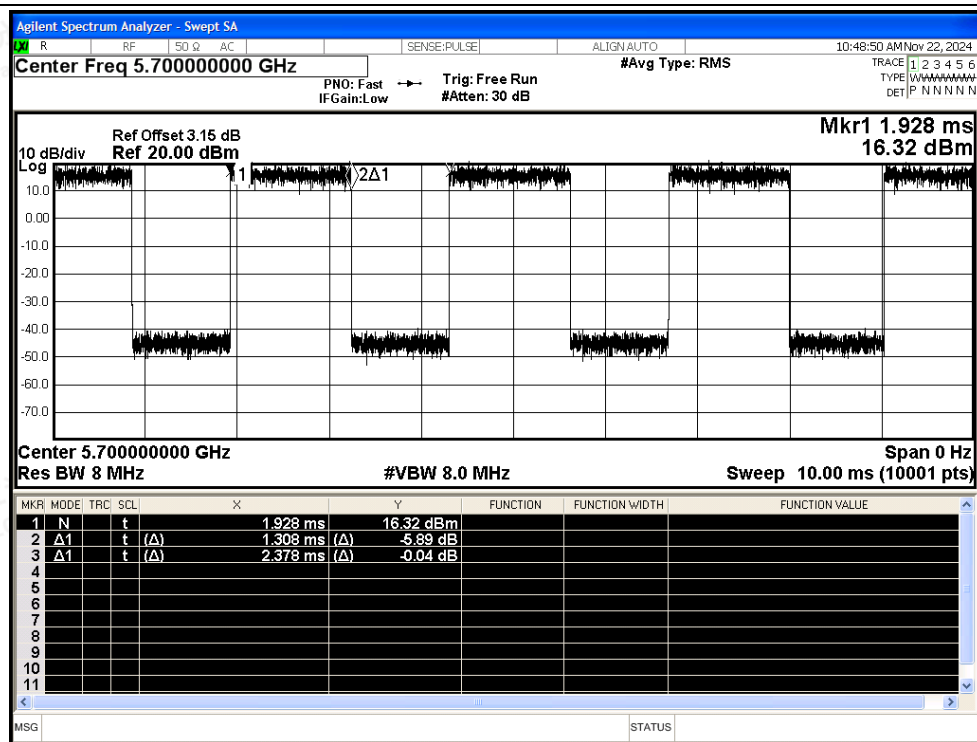

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5510MHz Ant7

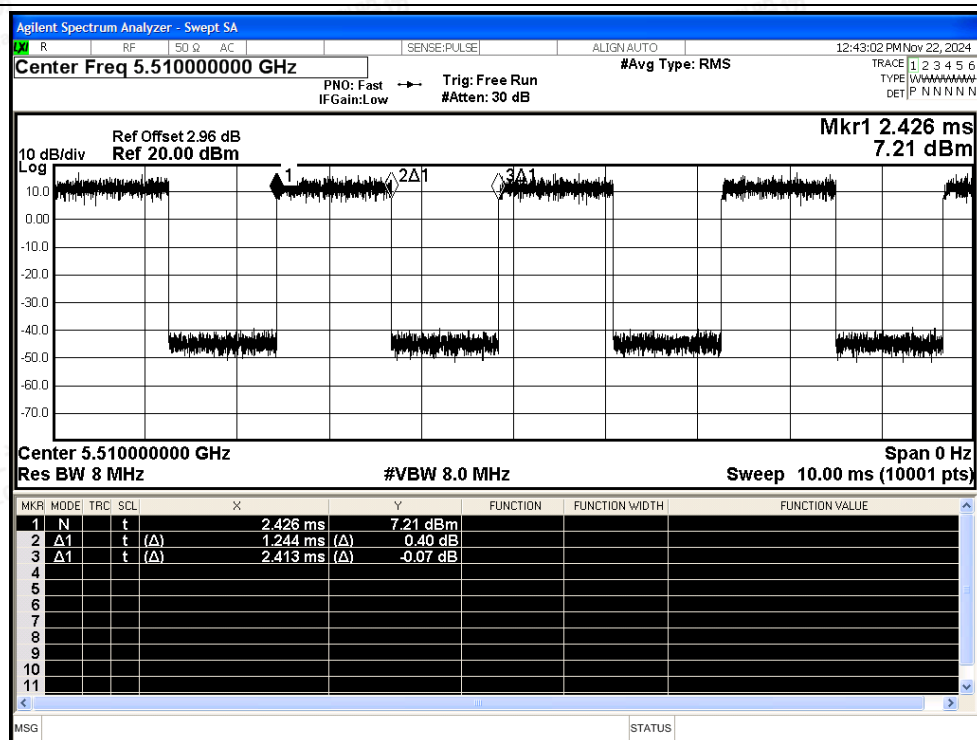

Duty Cycle NVNT ac40 5550MHz Ant7

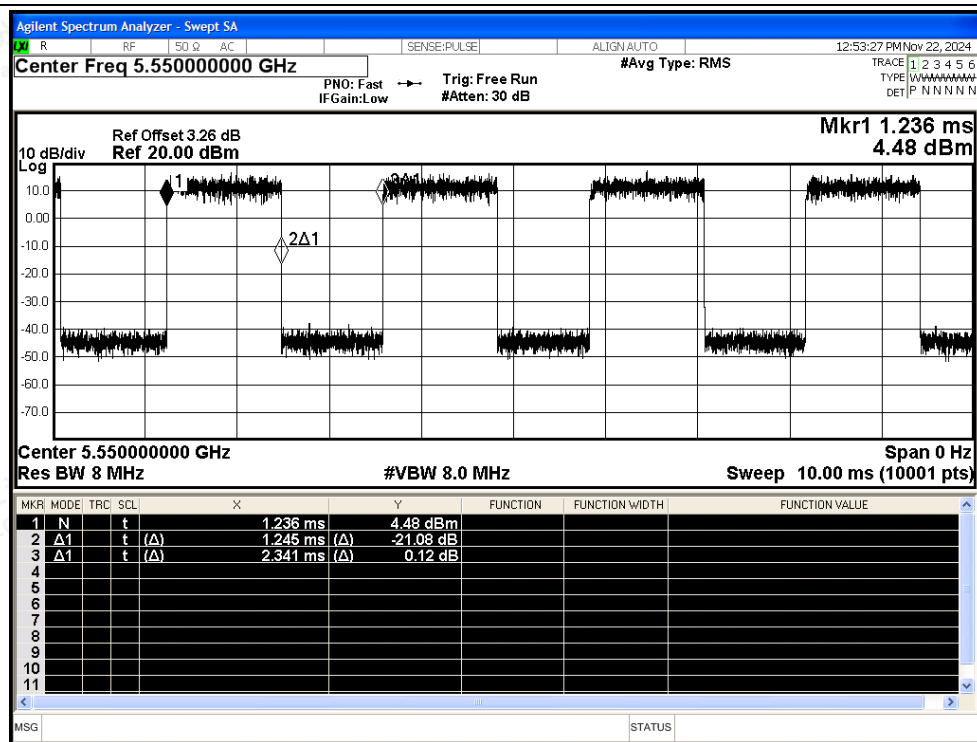

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac40 5670MHz Ant7

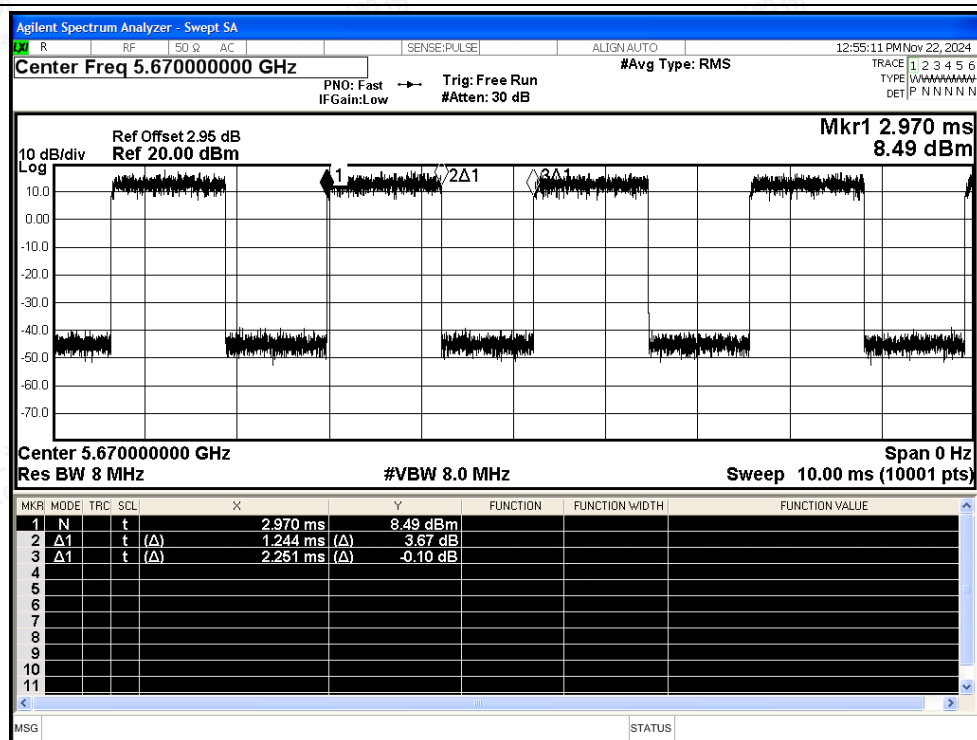

Duty Cycle NVNT ac80 5530MHz Ant7

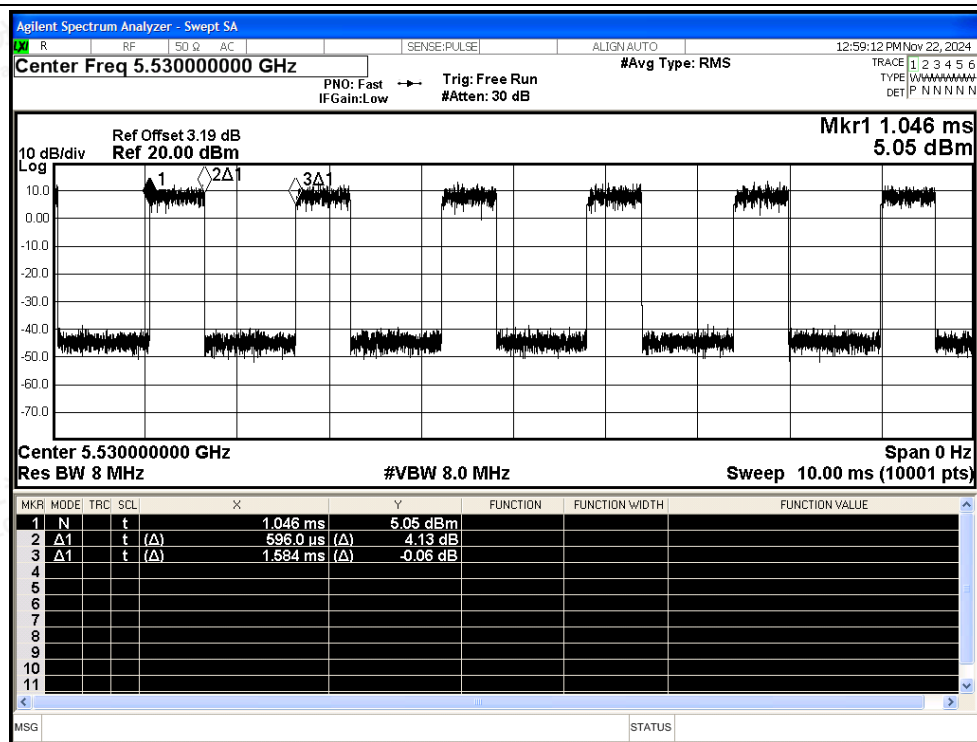

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ac80 5610MHz Ant7

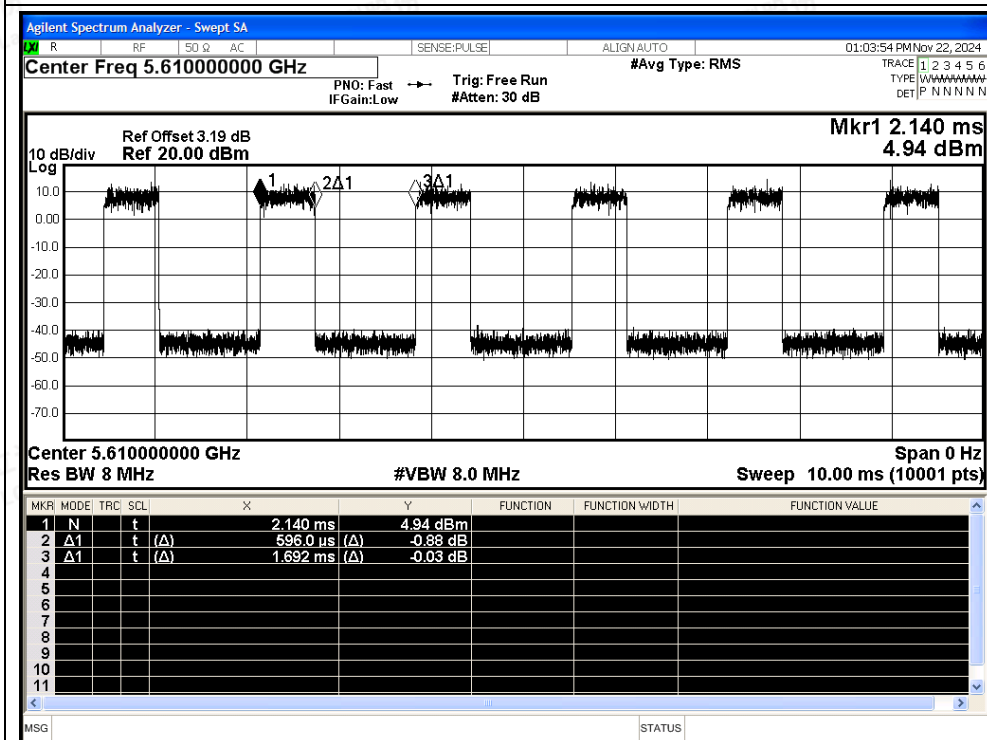

Duty Cycle NVNT ax20 5500MHz Ant7

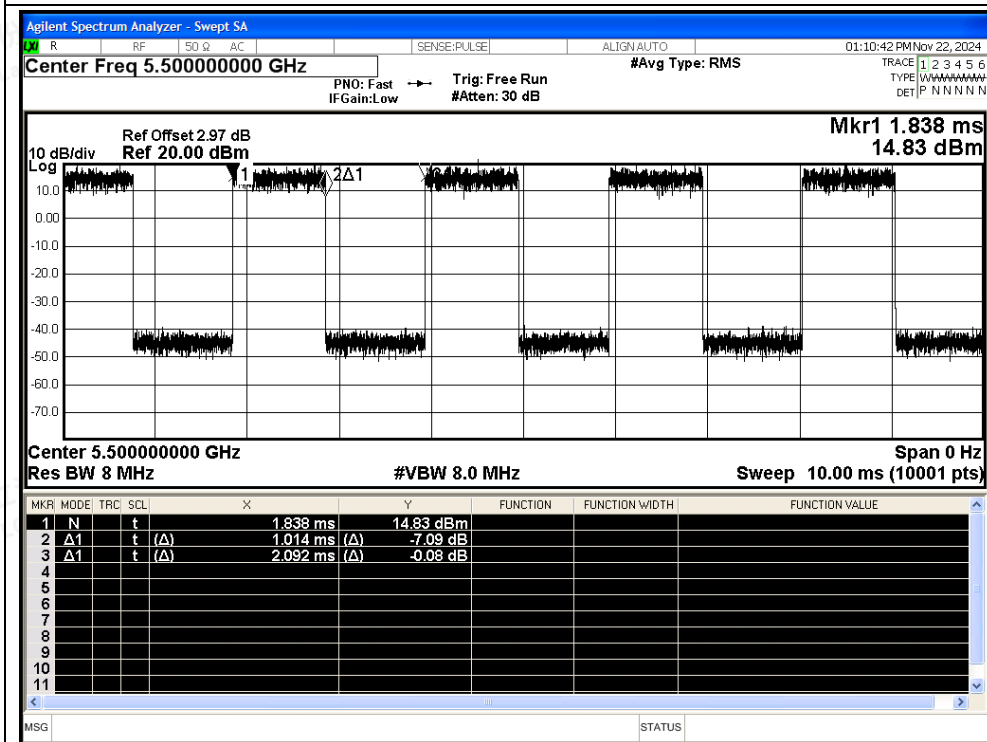

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax20 5580MHz Ant7

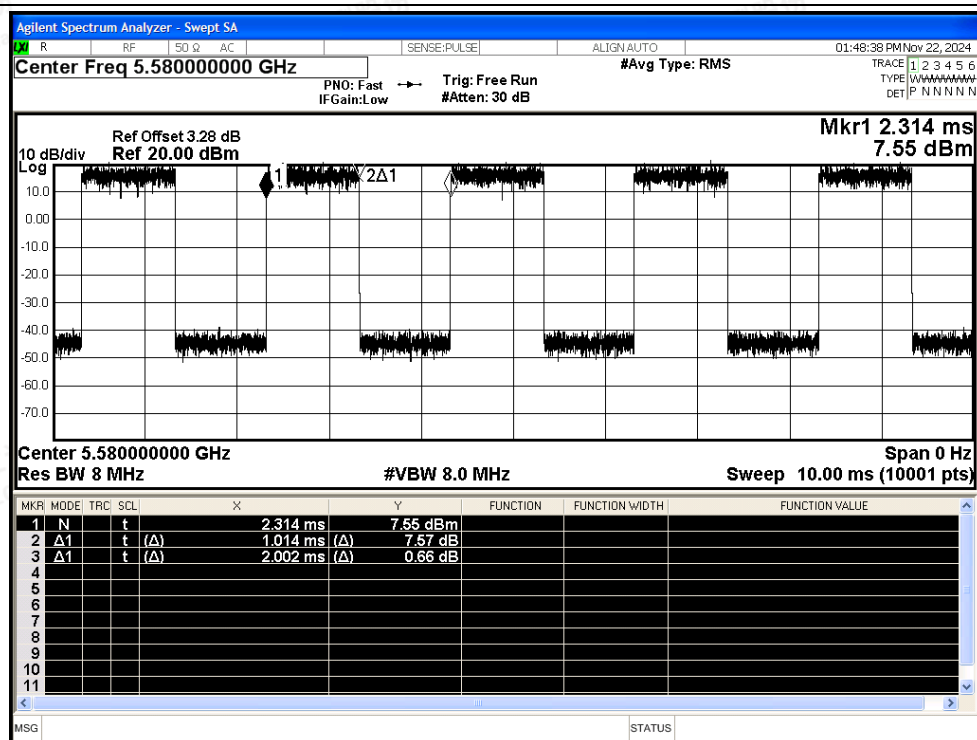

Duty Cycle NVNT ax20 5700MHz Ant7

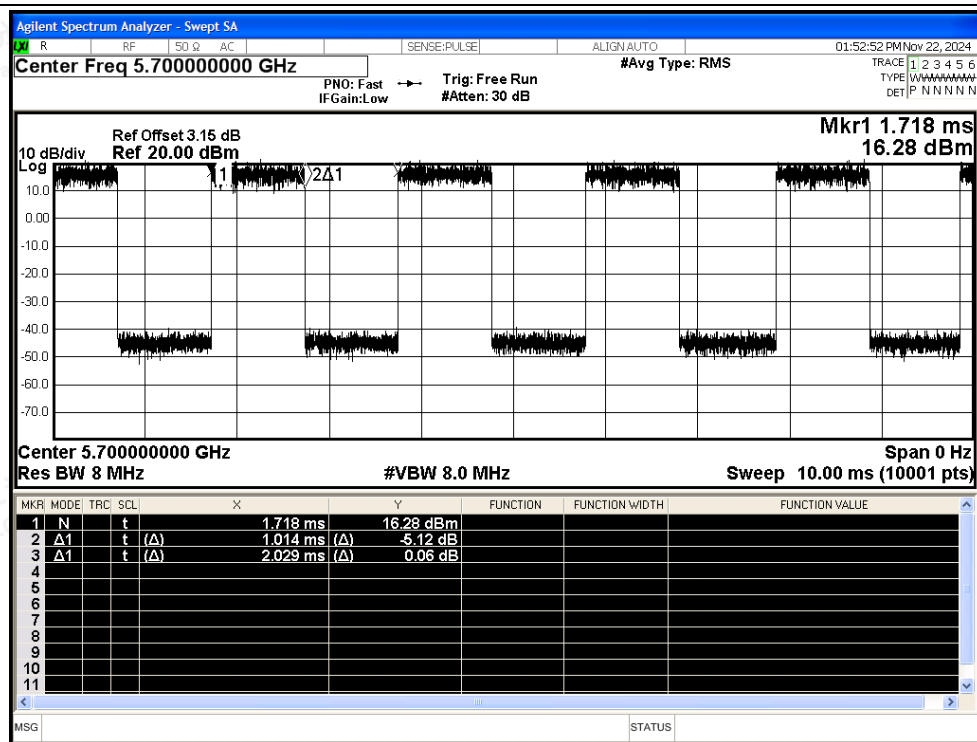

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5510MHz Ant7

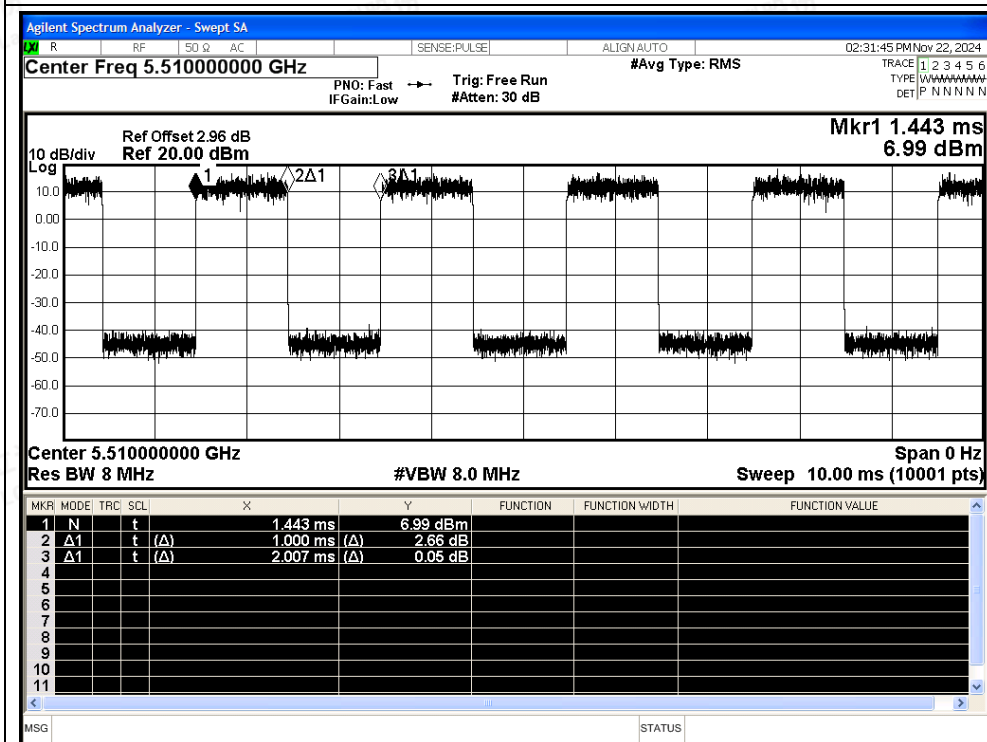

Duty Cycle NVNT ax40 5550MHz Ant7

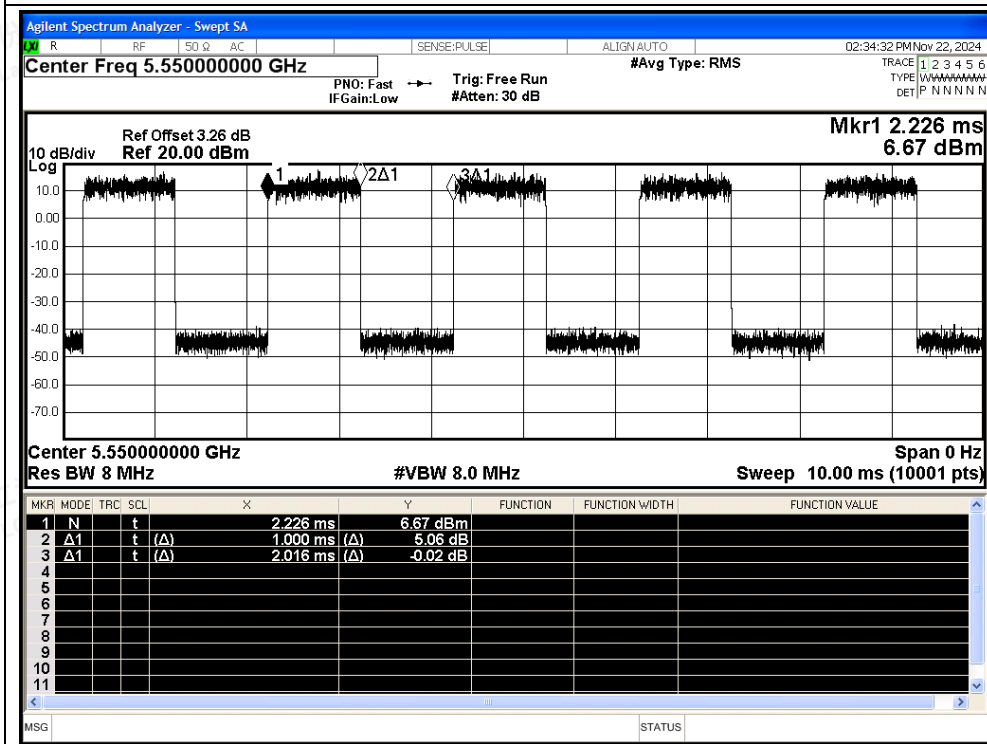

Shenzhen LCS Compliance Testing Laboratory Ltd.


Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com


Scan code to check authenticity



Duty Cycle NVNT ax40 5670MHz Ant7

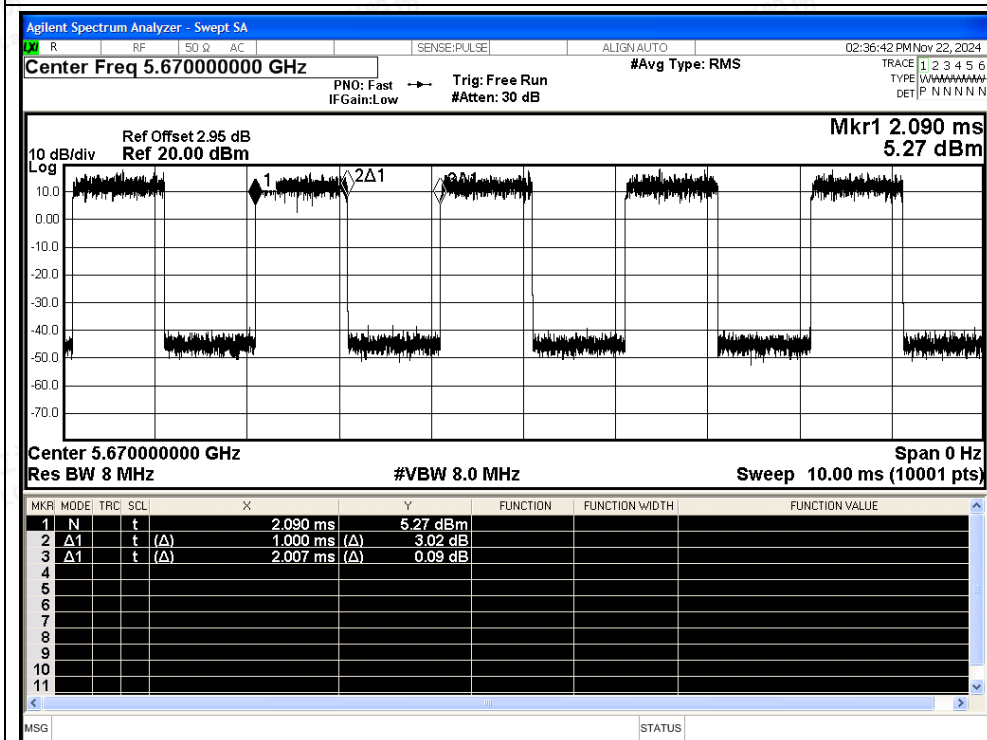

Duty Cycle NVNT ax80 5530MHz Ant7

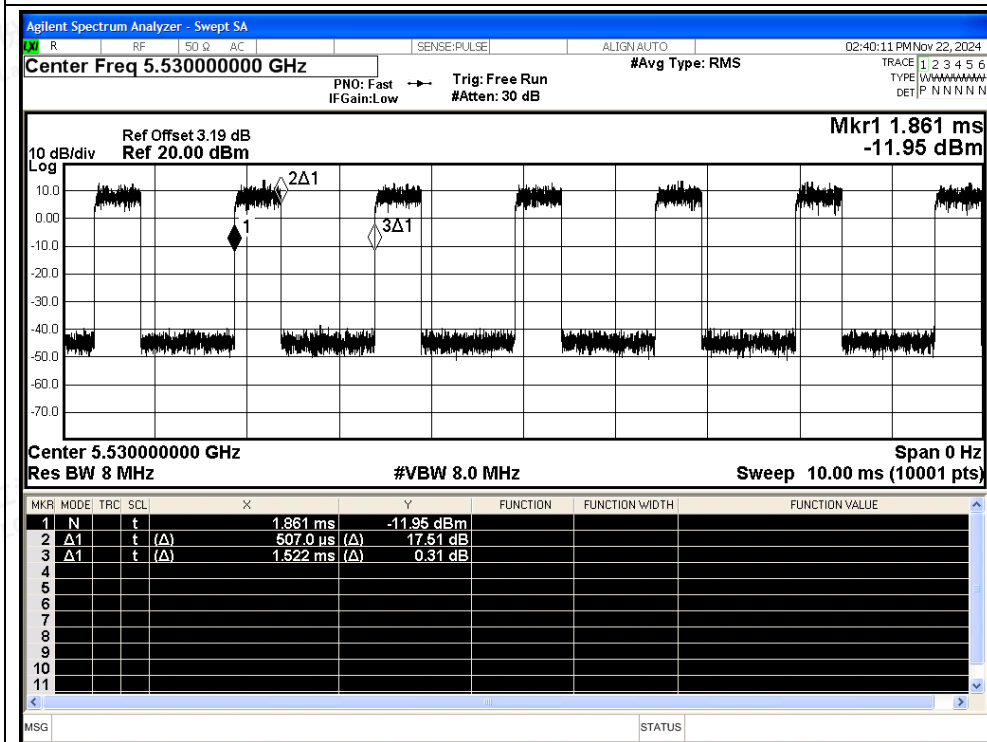

Shenzhen LCS Compliance Testing Laboratory Ltd.

Add: 101, 201 Bldg A & 301 Bldg C, Juji Industrial Park Yabianxueziwei, Shajing Street, Baoan District, Shenzhen, 518000, China

Tel: +(86) 0755-82591330 | E-mail: webmaster@lcs-cert.com | Web: www.lcs-cert.com

Scan code to check authenticity

