



Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix F: Bandedge


Condition	Antenna	Modulation	TX Mode	Ref_level(dBm)	Bandedge MAX.Value	Limit	Result
NVNT	ANT1	1-DH5	2402.00	-0.244	-53.552	-20.244	Pass
NVNT	ANT1	1-DH5	Hopping_LCH	-0.280	-56.664	-20.280	Pass
NVNT	ANT1	1-DH5	2480.00	-0.941	-60.448	-20.941	Pass
NVNT	ANT1	1-DH5	Hopping_HCH	-3.260	-61.749	-23.260	Pass
NVNT	ANT1	2-DH5	2402.00	-0.059	-49.120	-20.059	Pass
NVNT	ANT1	2-DH5	Hopping_LCH	-0.324	-57.618	-20.324	Pass
NVNT	ANT1	2-DH5	2480.00	-0.956	-62.164	-20.956	Pass
NVNT	ANT1	2-DH5	Hopping_HCH	-0.051	-58.387	-20.051	Pass
NVNT	ANT1	3-DH5	2402.00	-0.023	-52.598	-20.023	Pass
NVNT	ANT1	3-DH5	Hopping_LCH	-0.047	-55.999	-20.047	Pass
NVNT	ANT1	3-DH5	2480.00	-1.026	-61.917	-21.026	Pass
NVNT	ANT1	3-DH5	Hopping_HCH	-0.737	-58.488	-20.737	Pass

Remark:1. Regarding the spurious emissions from 30MHz to 26.5GHz, the cable lose have been set in the 'offset' of the Spectrum Analyzer during the test.


1_Reference_Level_NVNT_ANT1_1-DH5_2402_00




2_Bandedge_NVNT_ANT1_1-DH5_2402_00

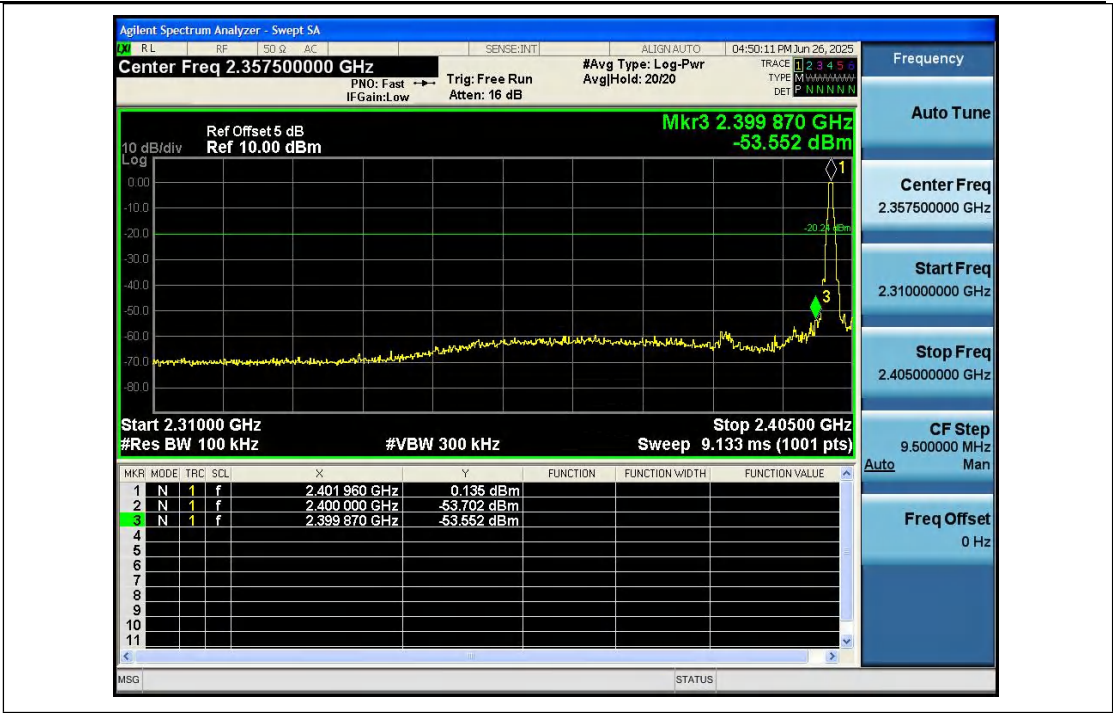


1_Reference_Level_Hopping_NVNT_ANT1_1-DH5_Hopping

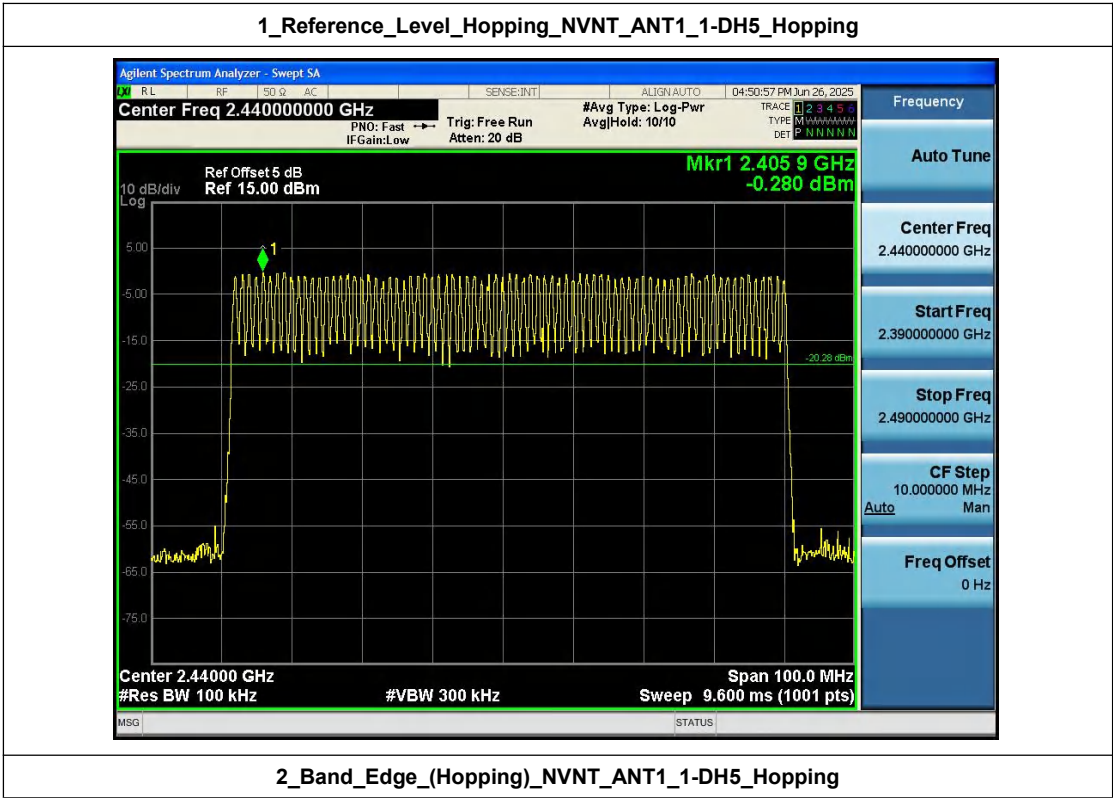


2_Band_Edge_(Hopping)_NVNT_ANT1_1-DH5_Hopping

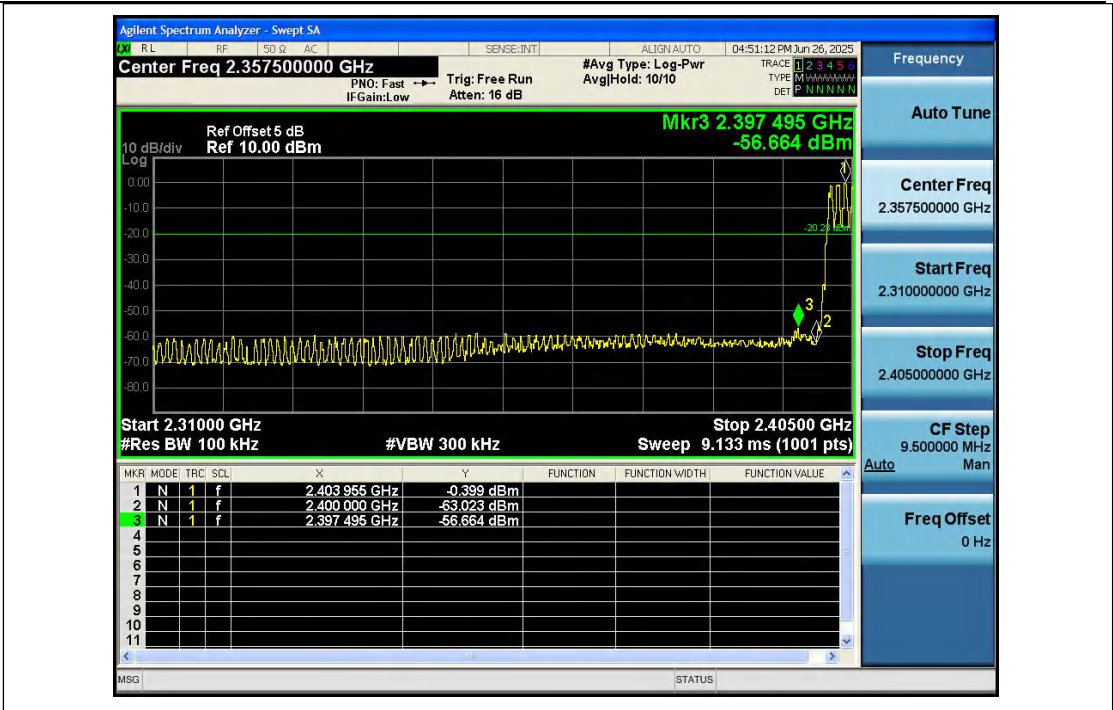


1_Reference_Level_NVNT_ANT1_1-DH5_2480_00

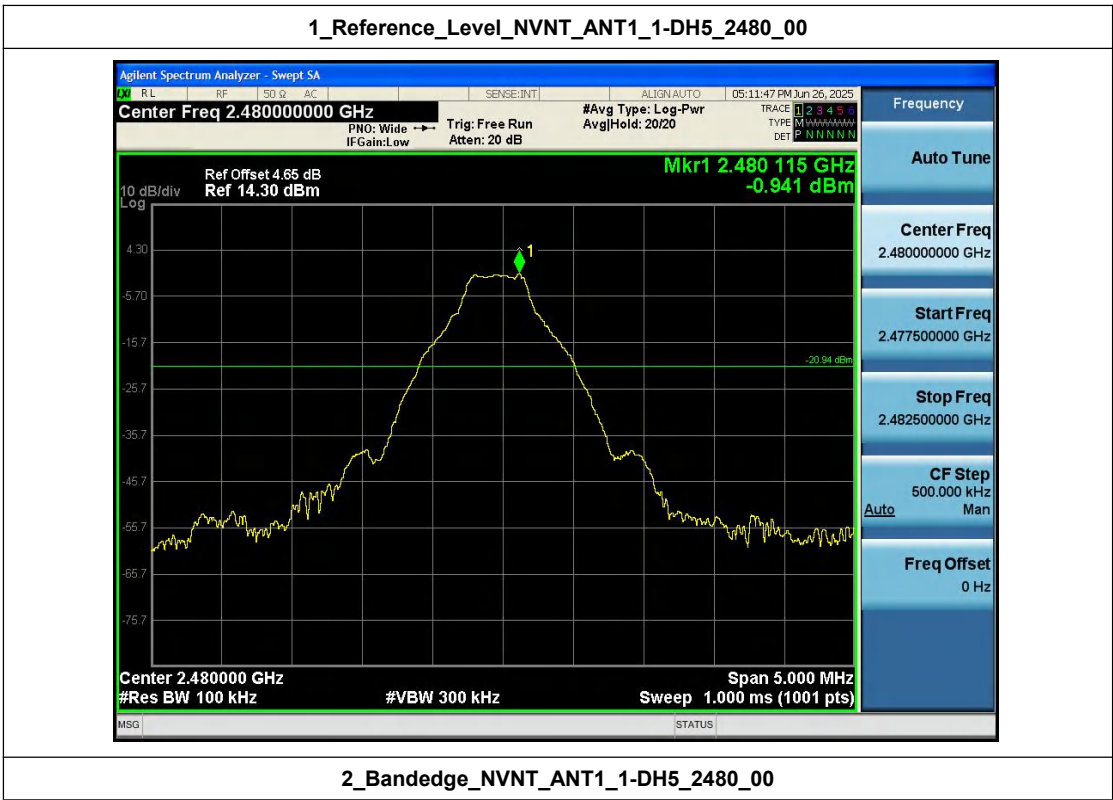


2_Bandedge_NVNT_ANT1_1-DH5_2480_00

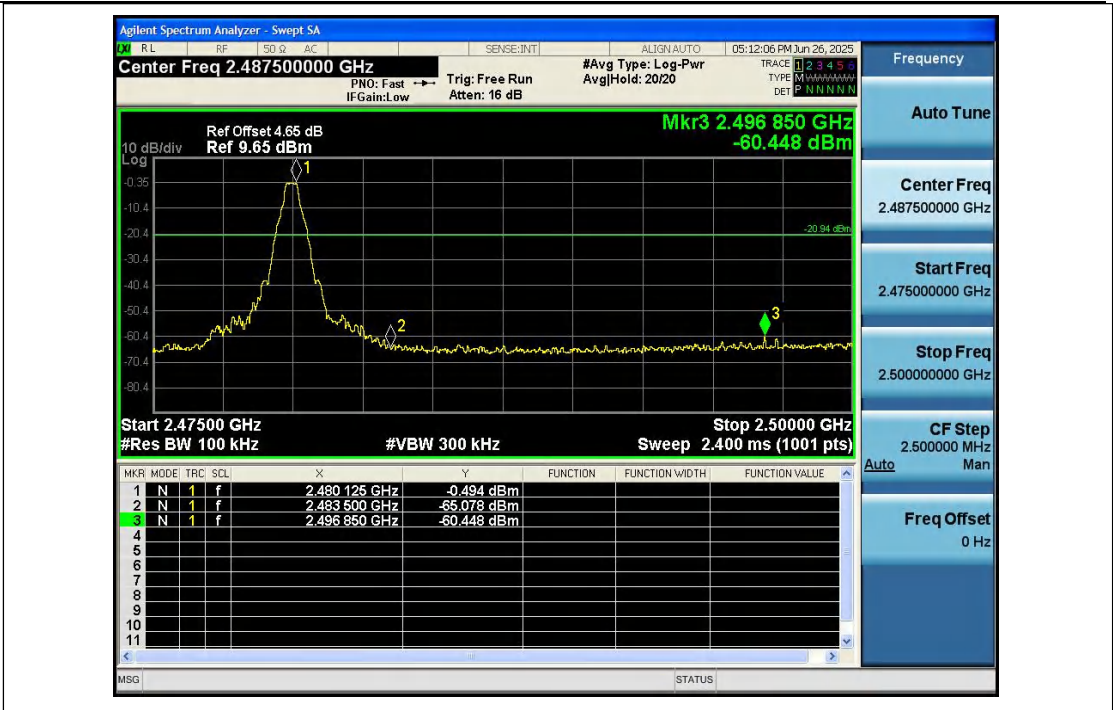


1_Reference_Level_Hopping_NVNT_ANT1_1-DH5_Hopping

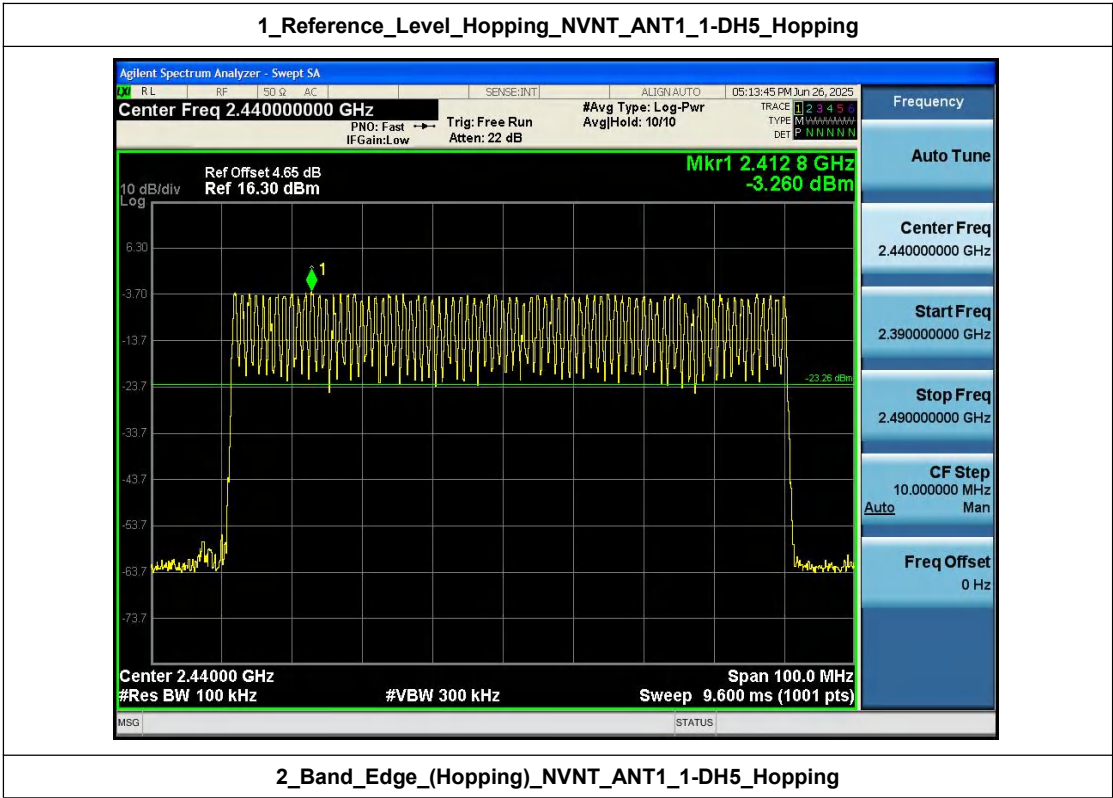


2_Band_Edge_(Hopping)_NVNT_ANT1_1-DH5_Hopping

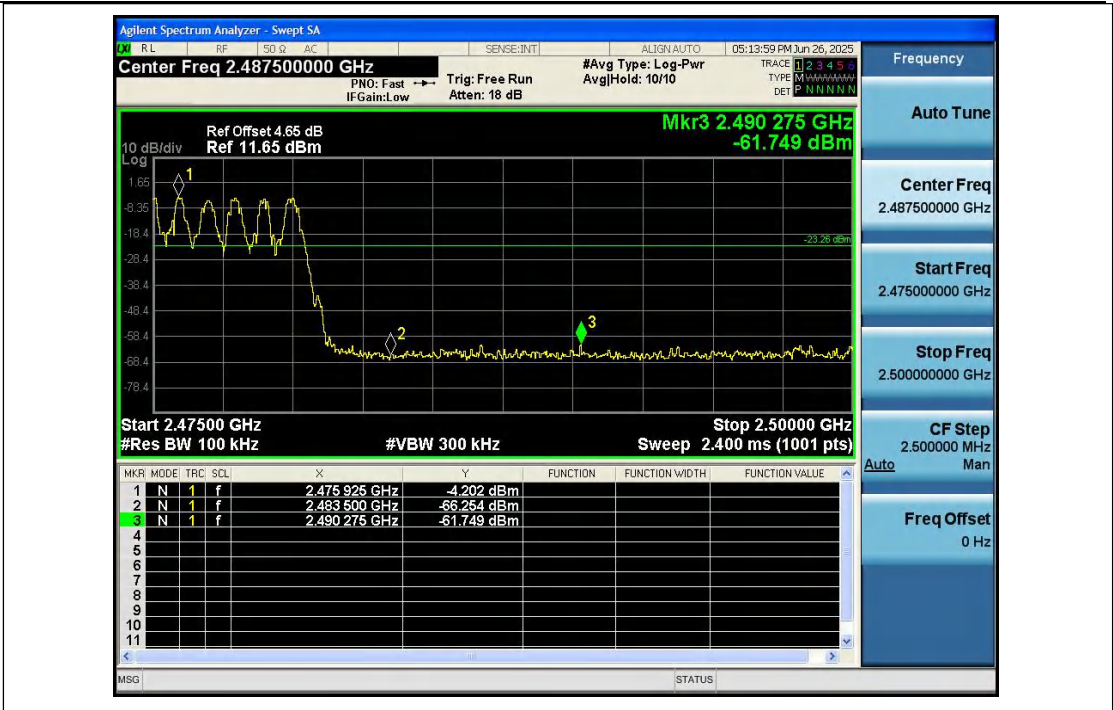


1_Reference_Level_NVNT_ANT1_2-DH5_2402_00

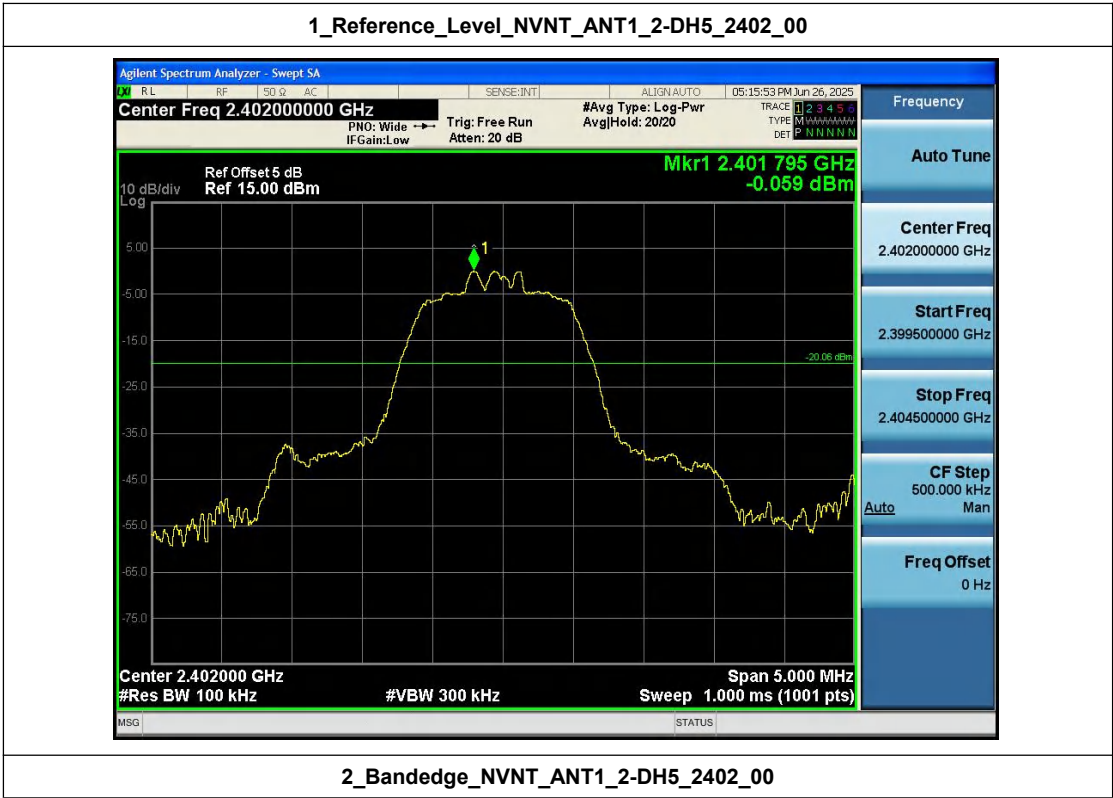


2_Bandedge_NVNT_ANT1_2-DH5_2402_00

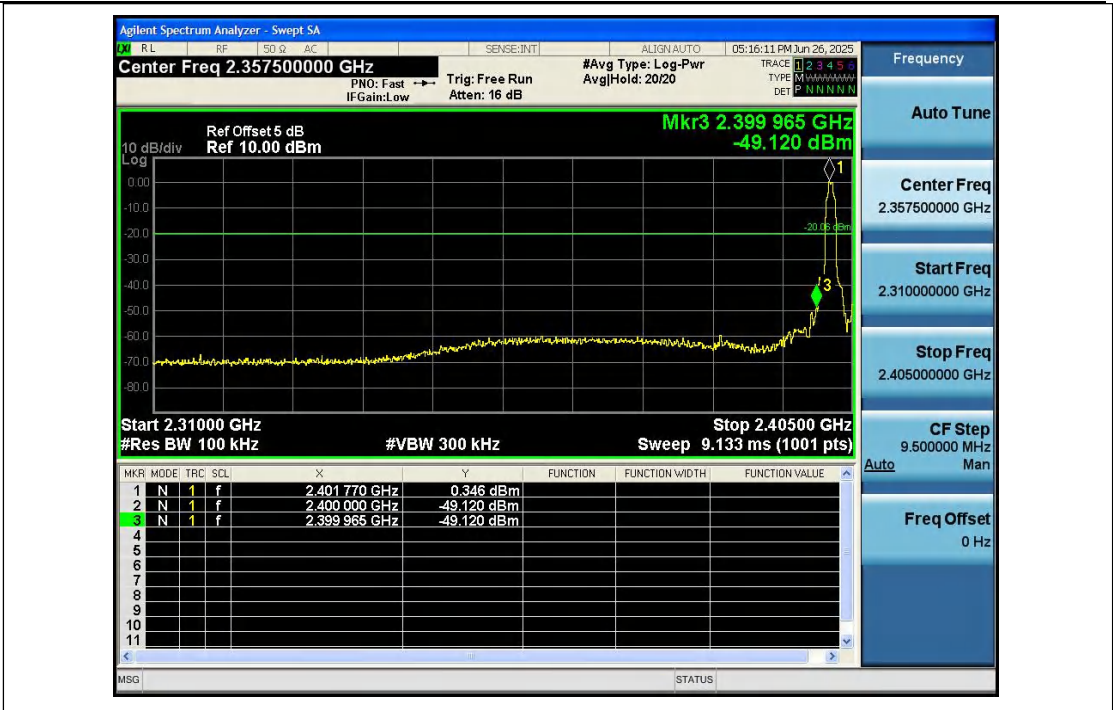


1_Reference_Level_Hopping_NVNT_ANT1_2-DH5_Hopping

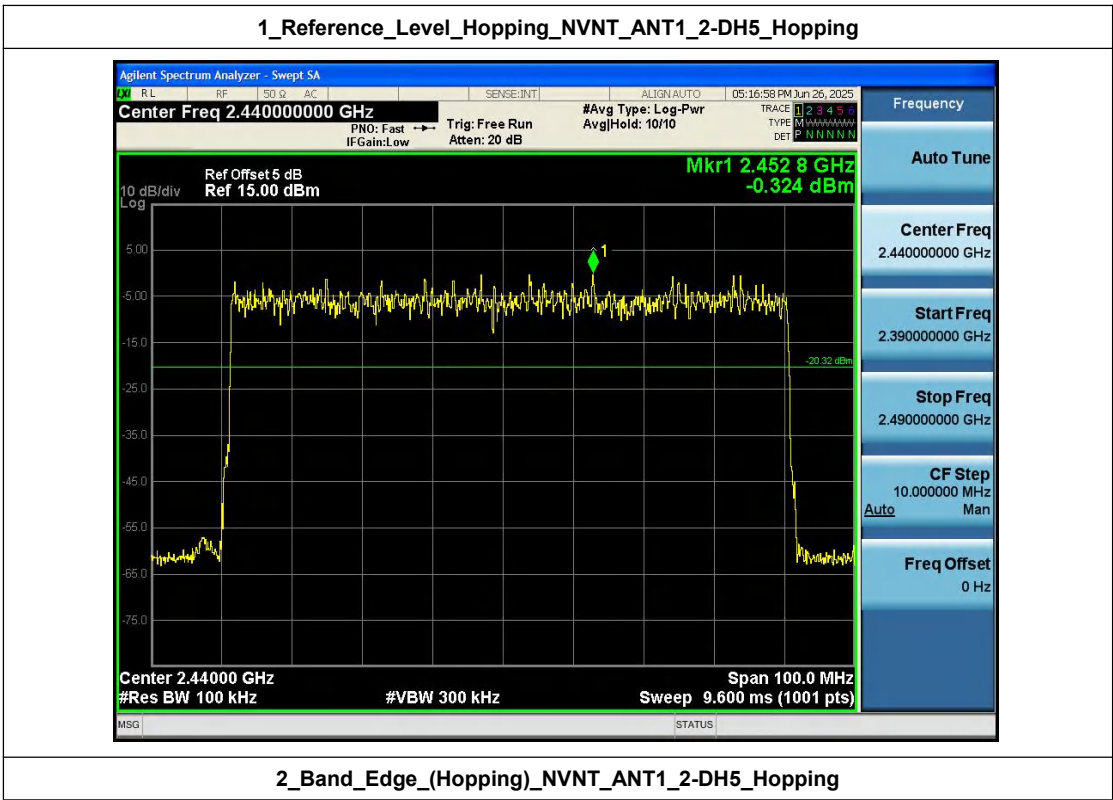


2_Band_Edge_(Hopping)_NVNT_ANT1_2-DH5_Hopping

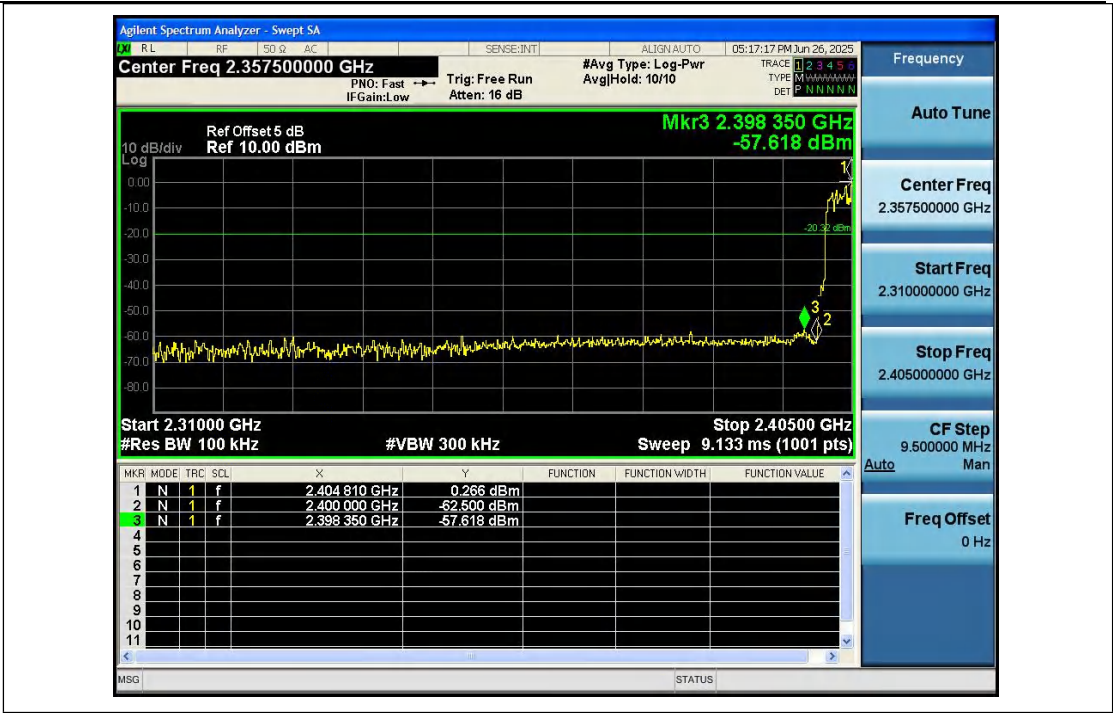


1_Reference_Level_NVNT_ANT1_2-DH5_2480_00

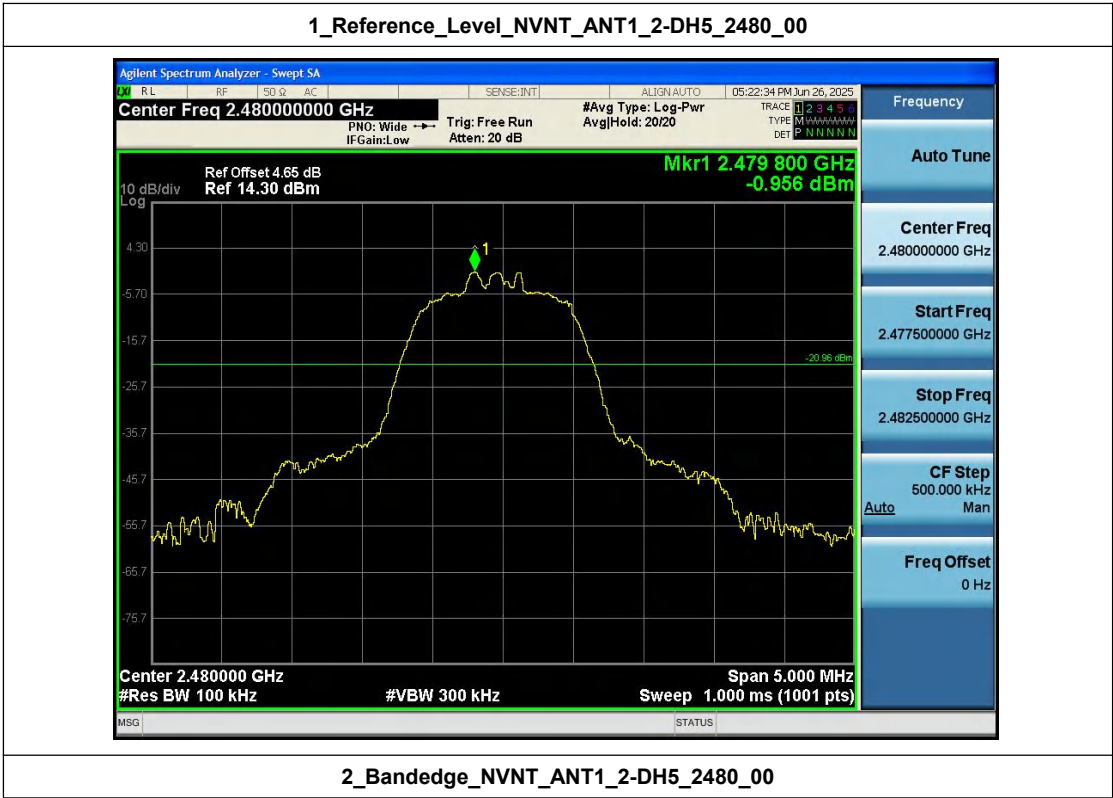


2_Bandedge_NVNT_ANT1_2-DH5_2480_00

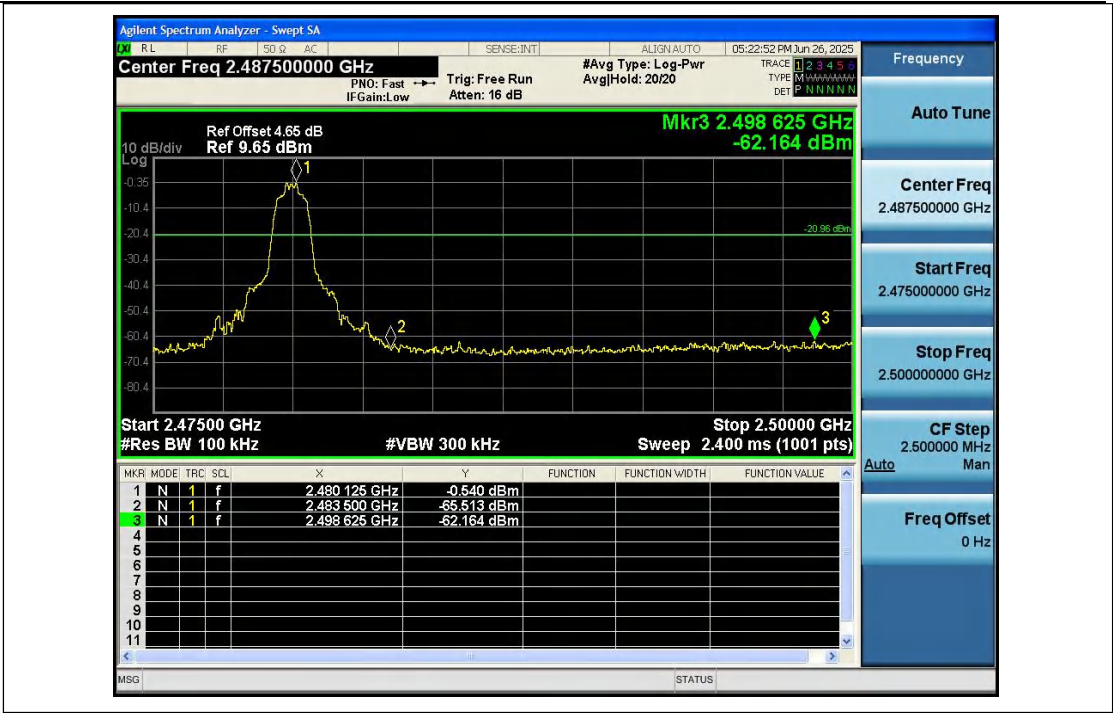


1_Reference_Level_Hopping_NVNT_ANT1_2-DH5_Hopping

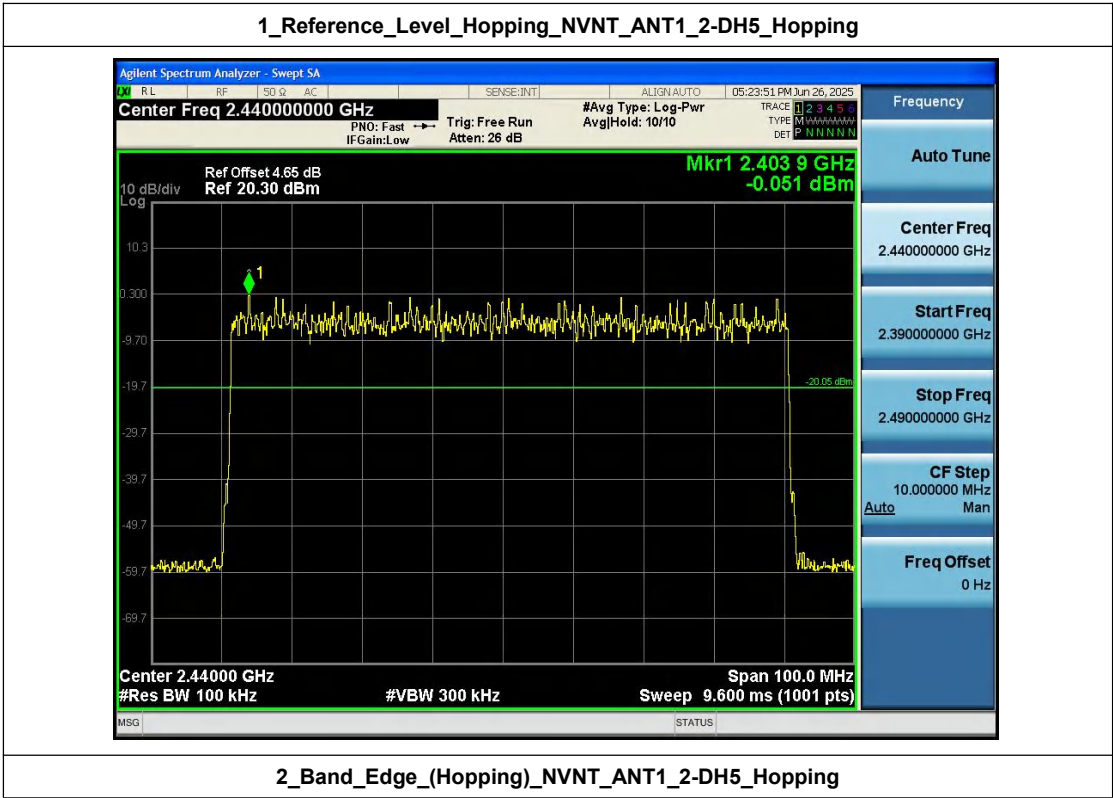

2_Band_Edge_(Hopping)_NVNT_ANT1_2-DH5_Hopping

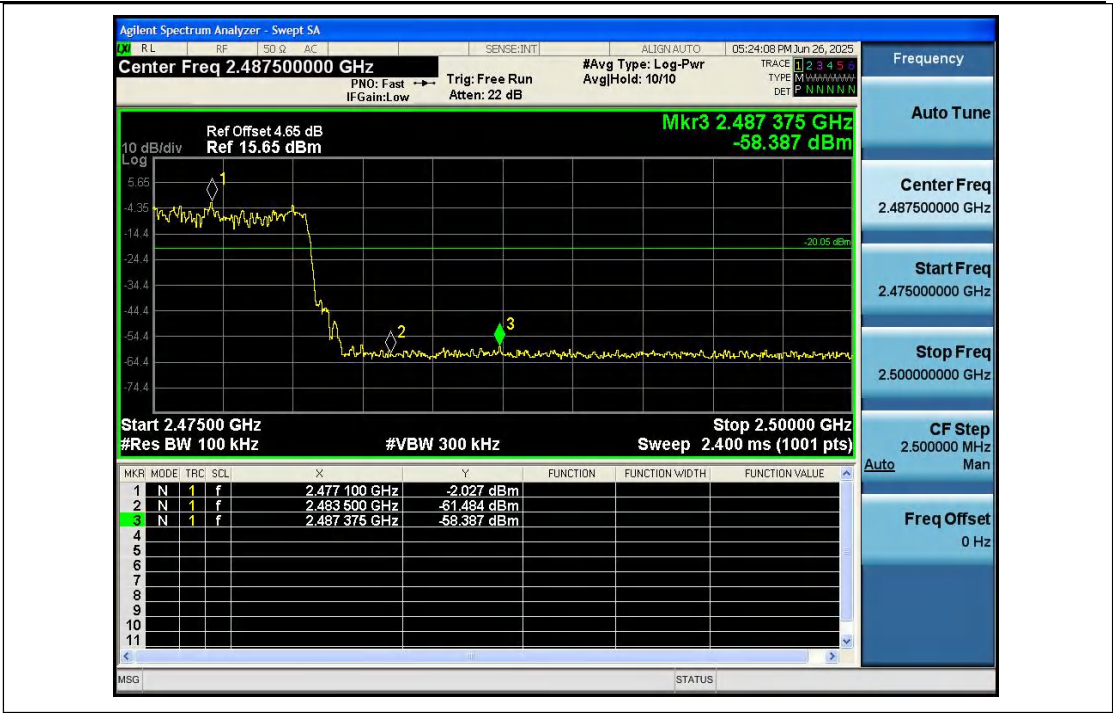


1_Reference_Level_NVNT_ANT1_3-DH5_2402_00

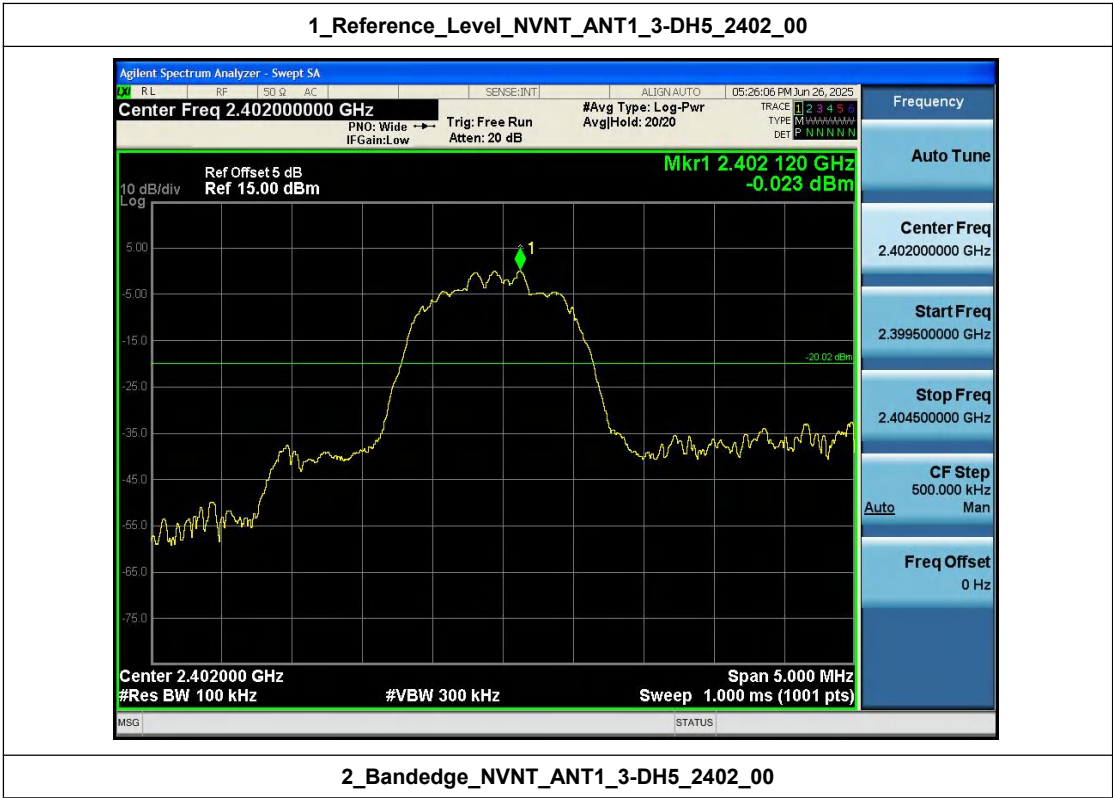


2_Bandedge_NVNT_ANT1_3-DH5_2402_00




1_Reference_Level_Hopping_NVNT_ANT1_3-DH5_Hopping

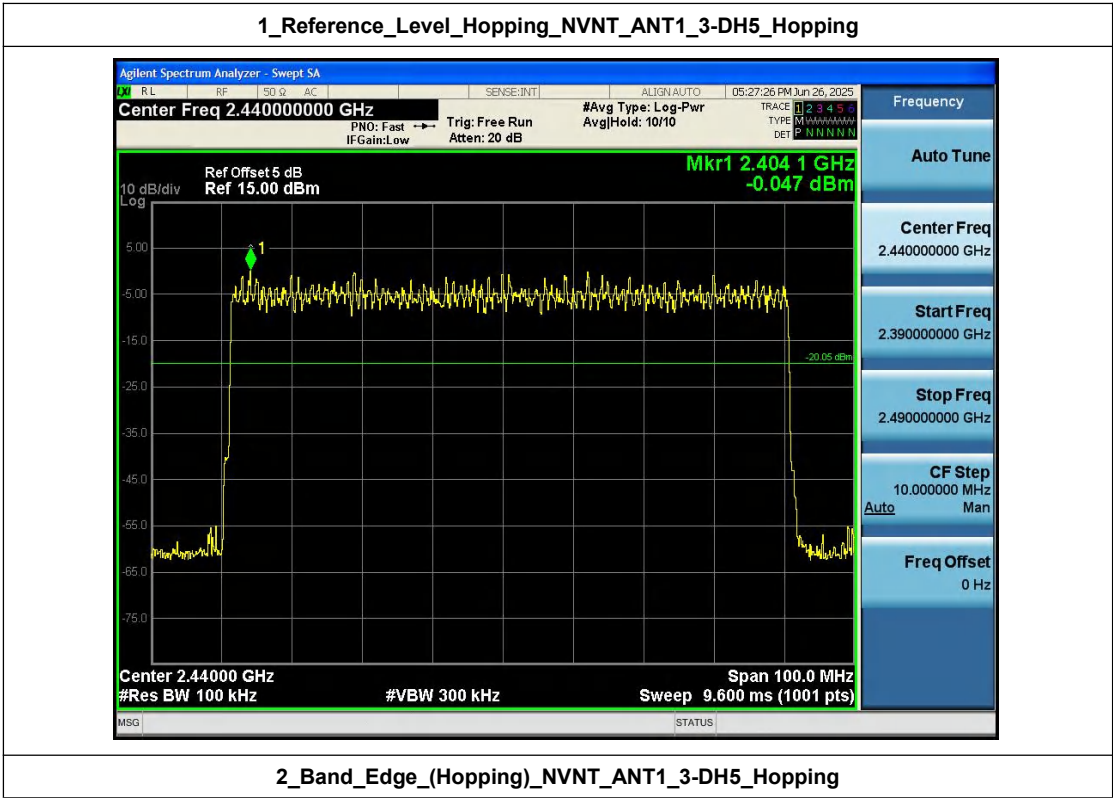


2_Band_Edge_(Hopping)_NVNT_ANT1_3-DH5_Hopping

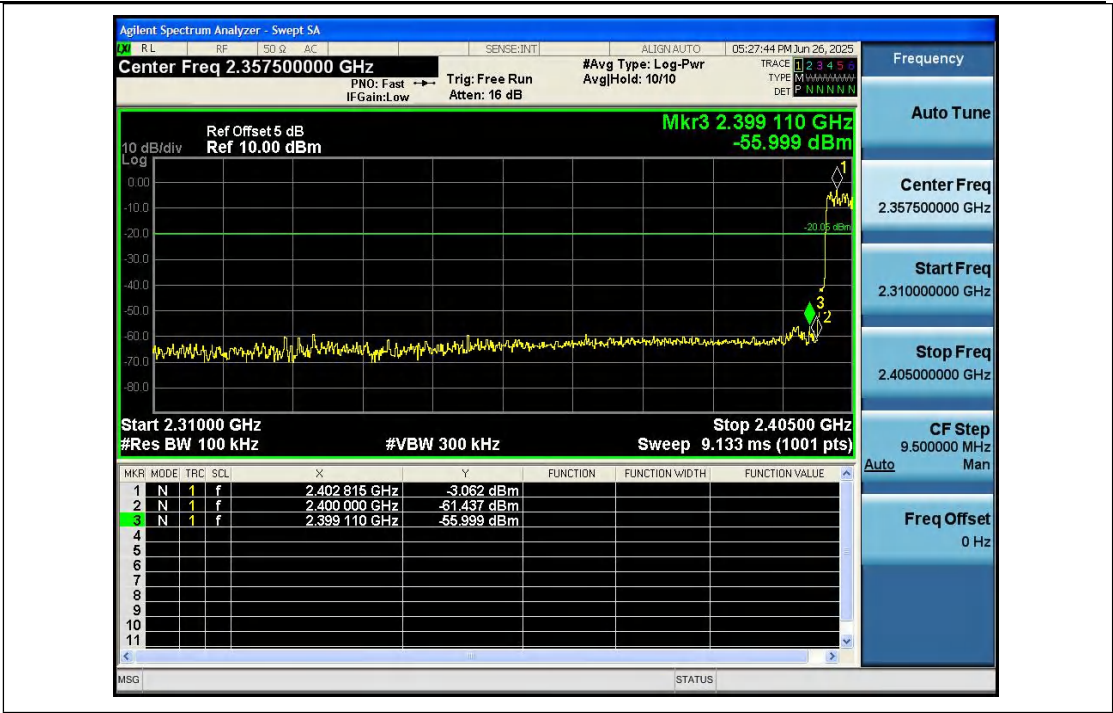


1_Reference_Level_NVNT_ANT1_3-DH5_2480_00

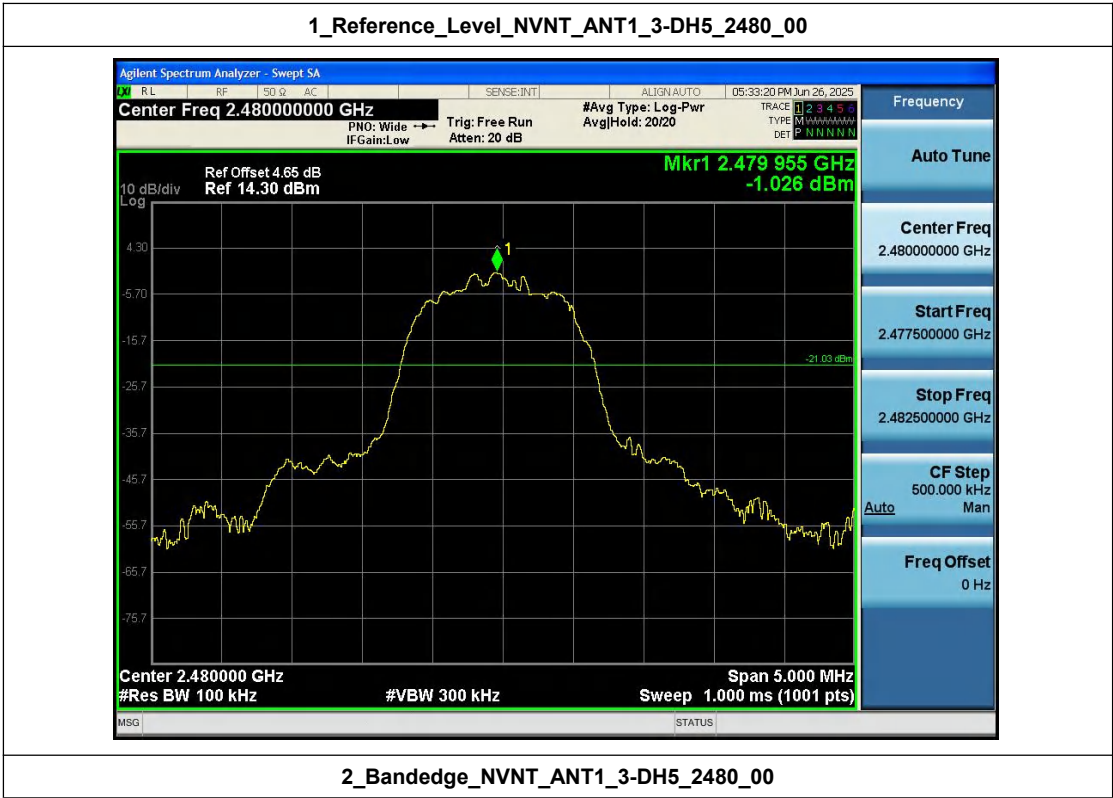


2_Bandedge_NVNT_ANT1_3-DH5_2480_00

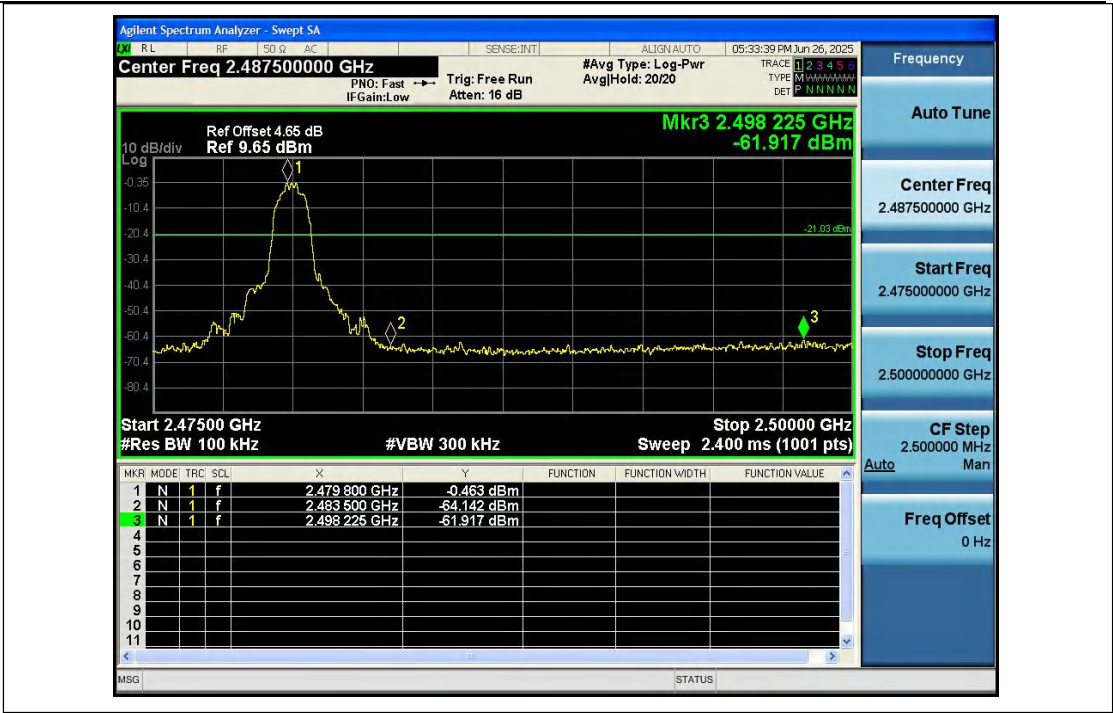

1_Reference_Level_Hopping_NVNT_ANT1_3-DH5_Hopping

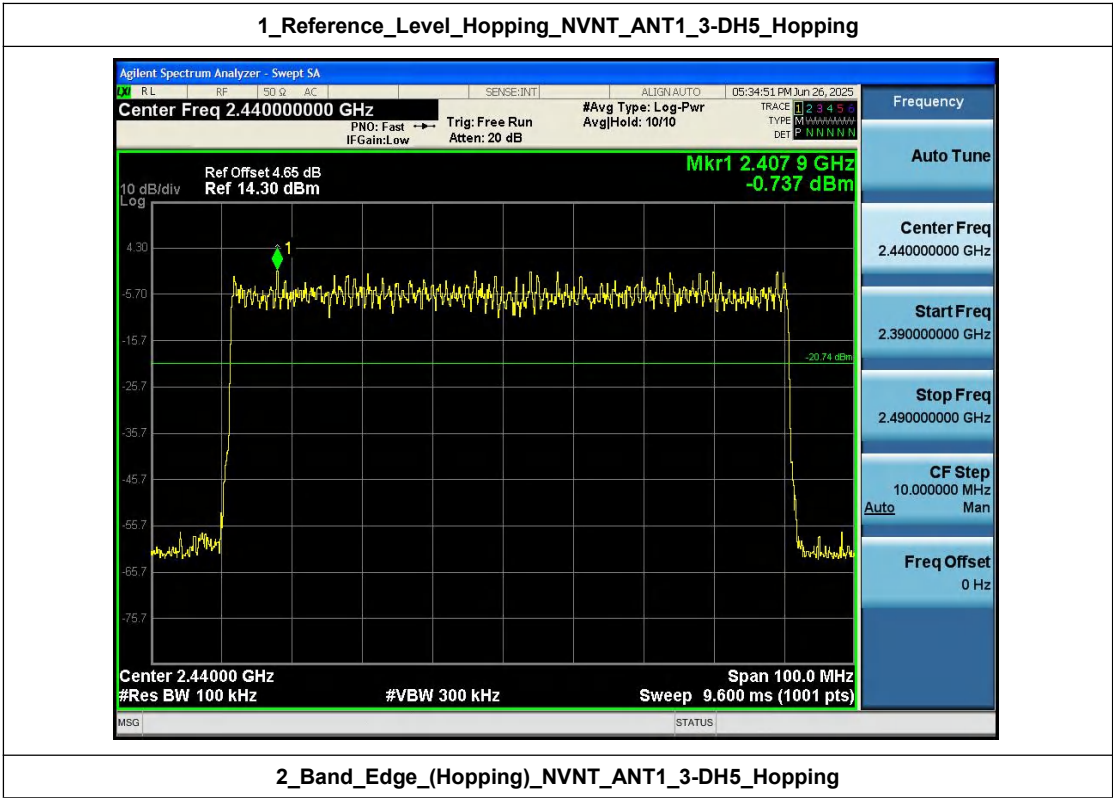

2_Band_Edge_(Hopping)_NVNT_ANT1_3-DH5_Hopping

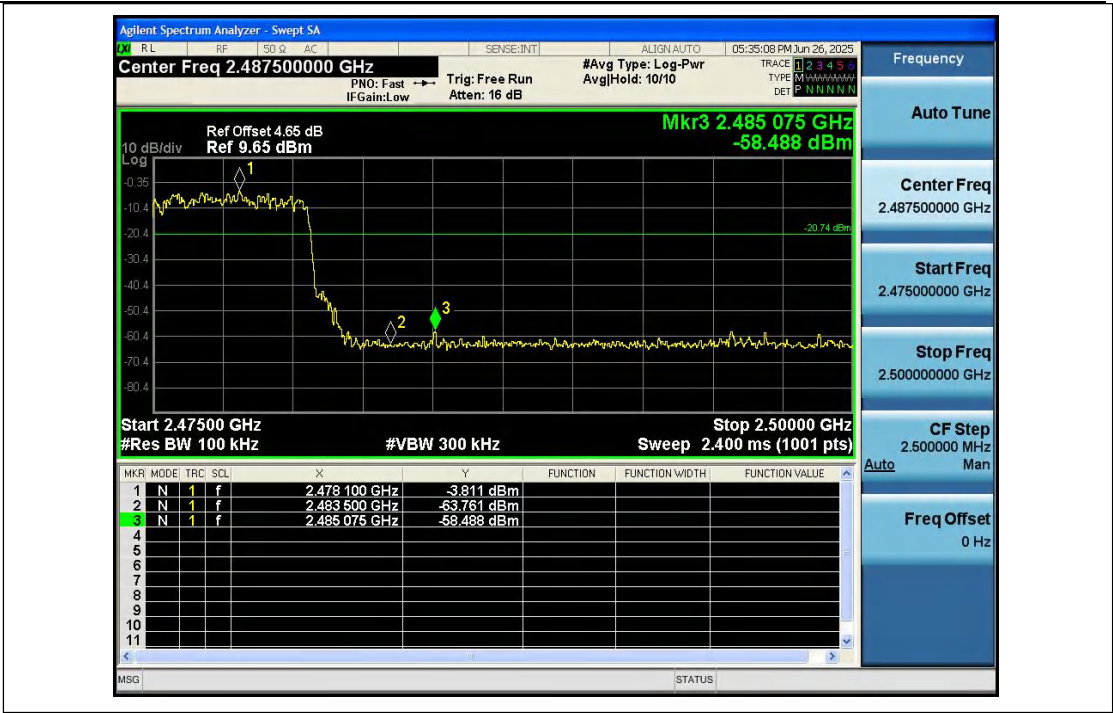

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

Appendix G: Carrier Frequencies Separation (Hopping)

Condition	Antenna	Modulation	Frequency(MHz)	Hopping NO.0 (MHz)	Hopping NO.1 (MHz)	Carrier Frequencies Separation(MHz)	Limit(MHz)	Result
NVNT	ANT1	1-DH5	2441.00	2441.086	2441.791	0.70	0.676	Pass
NVNT	ANT1	2-DH5	2441.00	2440.702	2441.800	1.10	0.858	Pass
NVNT	ANT1	3-DH5	2441.00	2440.732	2441.818	1.09	0.867	Pass


Carrier_Frequencies_Separation_(Hopping)_NVNT_ANT1_1-DH5_Hopping



Carrier_Frequencies_Separation_(Hopping)_NVNT_ANT1_2-DH5_Hopping




Carrier_Frequencies_Separation_(Hopping)_NVNT_ANT1_3-DH5_Hopping

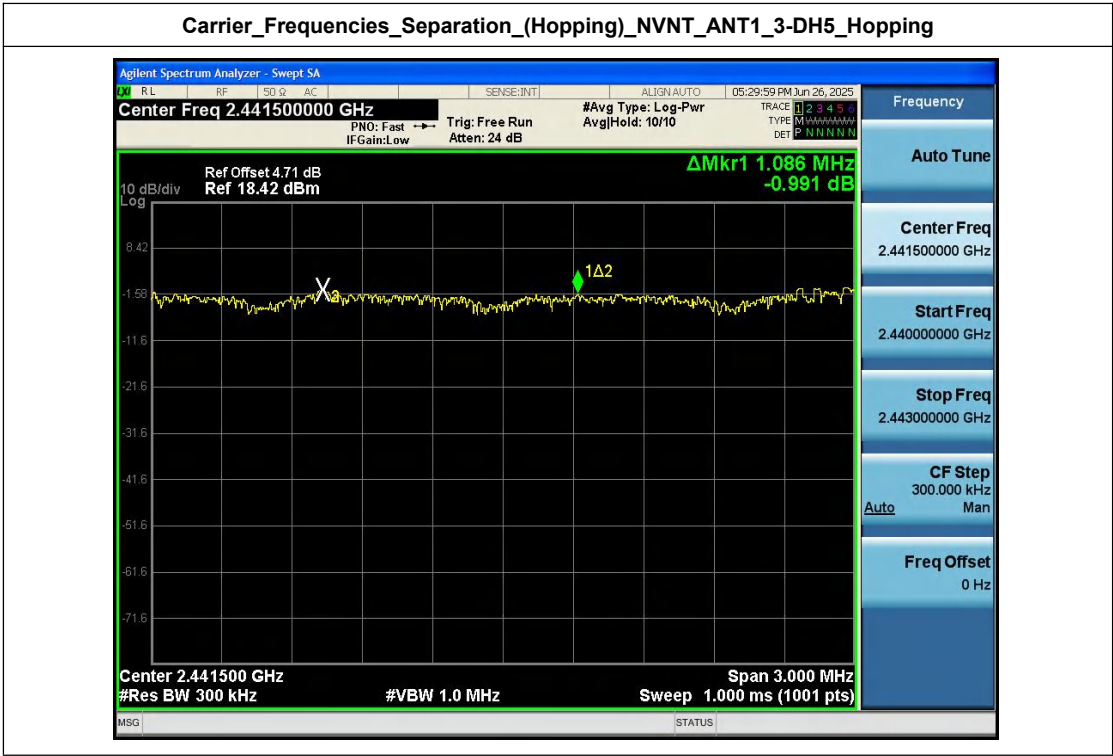


Appendix H: Number of Hopping Channel (Hopping)

Condition	Antenna	Modulation	Hopping Num	Limit	Result
NVNT	ANT1	1-DH5	79	15	Pass
NVNT	ANT1	2-DH5	79	15	Pass
NVNT	ANT1	3-DH5	79	15	Pass

Number_of_Hopping_Channel_(Hopping)_NVNT_ANT1_1-DH5_Hopping

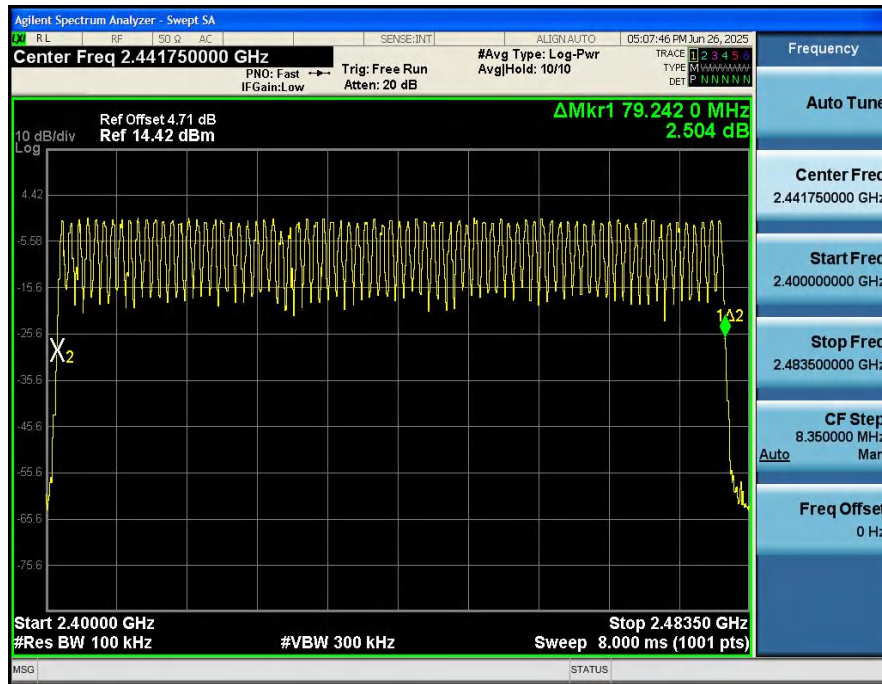


Number_of_Hopping_Channel_(Hopping)_NVNT_ANT1_2-DH5_Hopping

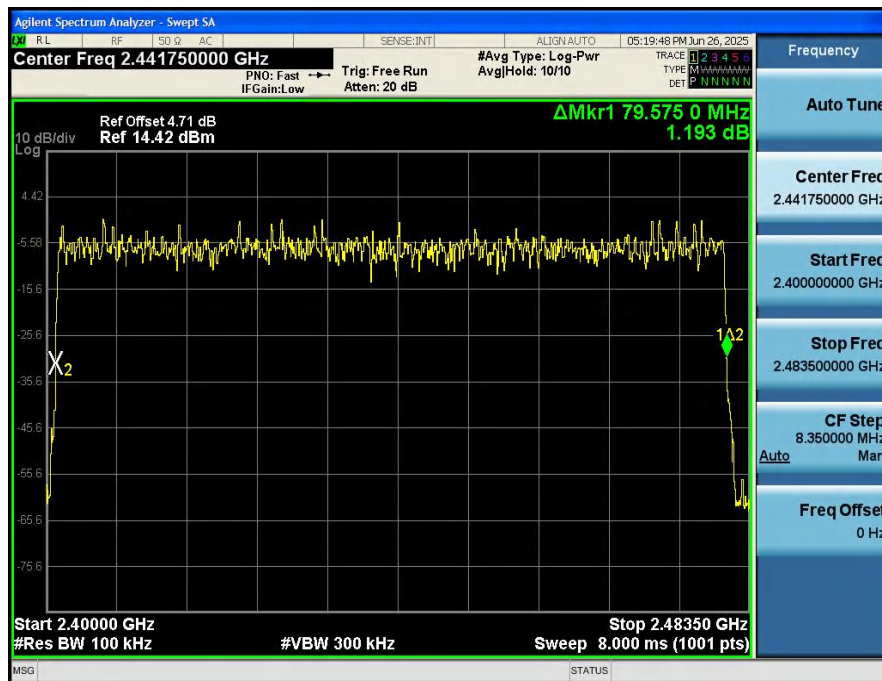

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com

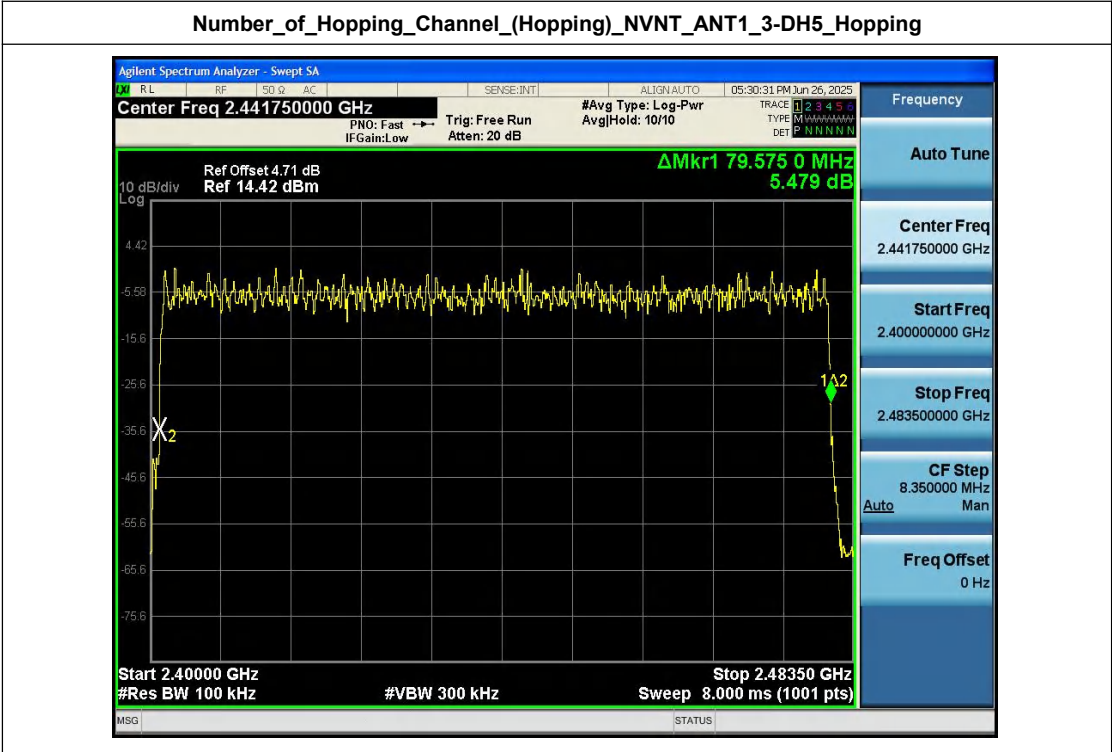


Shenzhen Anbotek Compliance Laboratory Limited


Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com


Appendix I: Dwell Time (Hopping)

Condition	Antenna	Packet Type	Pulse Time(ms)	Hops	Dwell Time(ms)	Limit(s)	Result
NVNT	ANT1	1-DH5	2.890	103.00	297.670	0.40	Pass
NVNT	ANT1	2-DH5	2.900	104.00	301.600	0.40	Pass
NVNT	ANT1	3-DH5	2.910	110.00	320.100	0.40	Pass
NVNT	ANT1	1-DH1	0.390	320.00	124.800	0.40	Pass
NVNT	ANT1	1-DH3	1.650	157.00	259.050	0.40	Pass
NVNT	ANT1	2-DH1	0.400	319.00	127.600	0.40	Pass
NVNT	ANT1	2-DH3	1.650	160.00	264.000	0.40	Pass
NVNT	ANT1	3-DH1	0.400	320.00	128.000	0.40	Pass
NVNT	ANT1	3-DH3	1.650	172.00	283.800	0.40	Pass

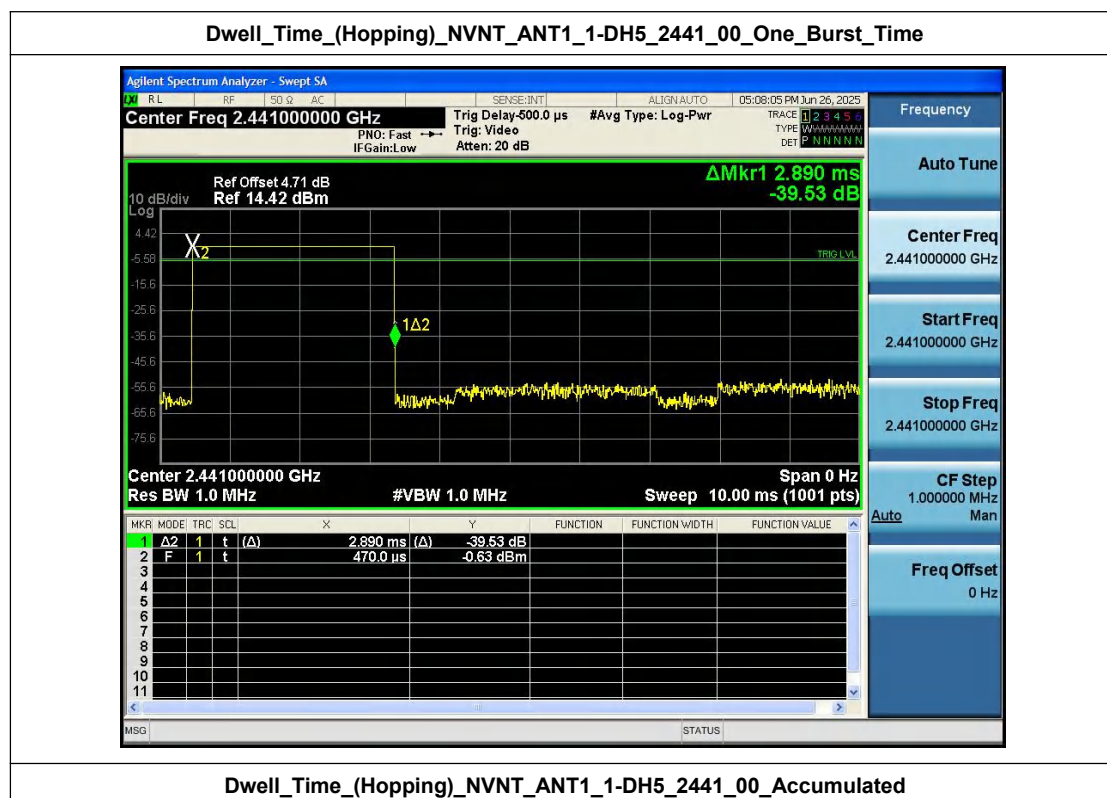


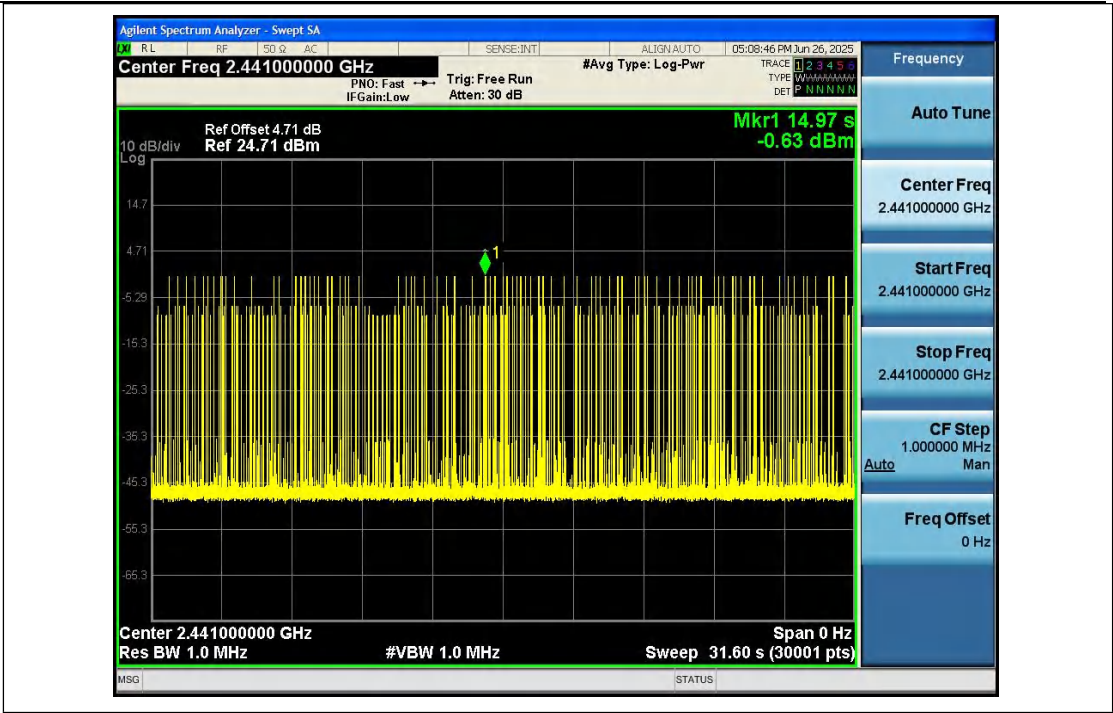


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH5_2441_00_One_Burst_Time

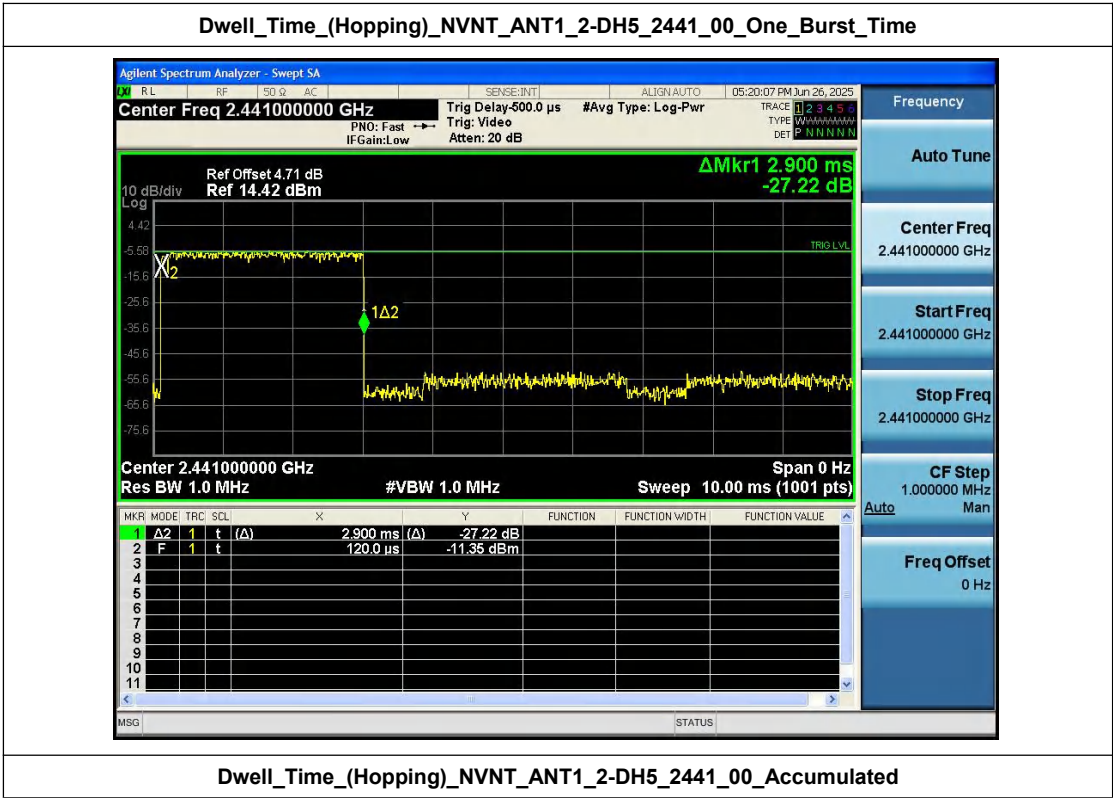


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH5_2441_00_Accumulated

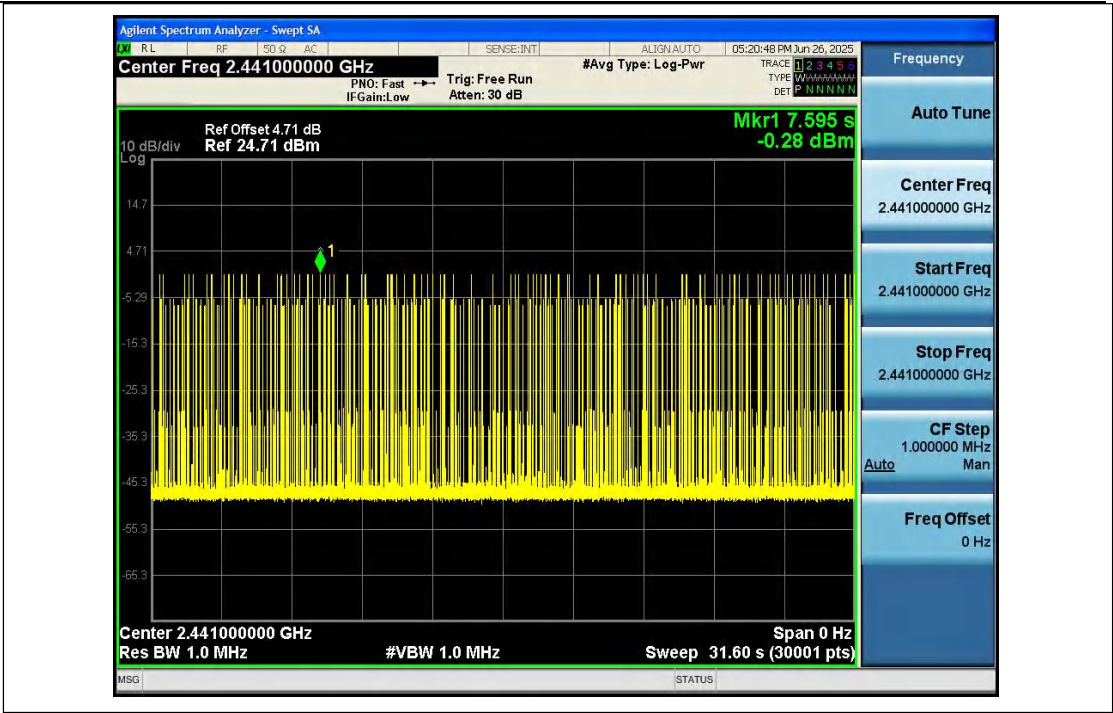


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH5_2441_00_One_Burst_Time

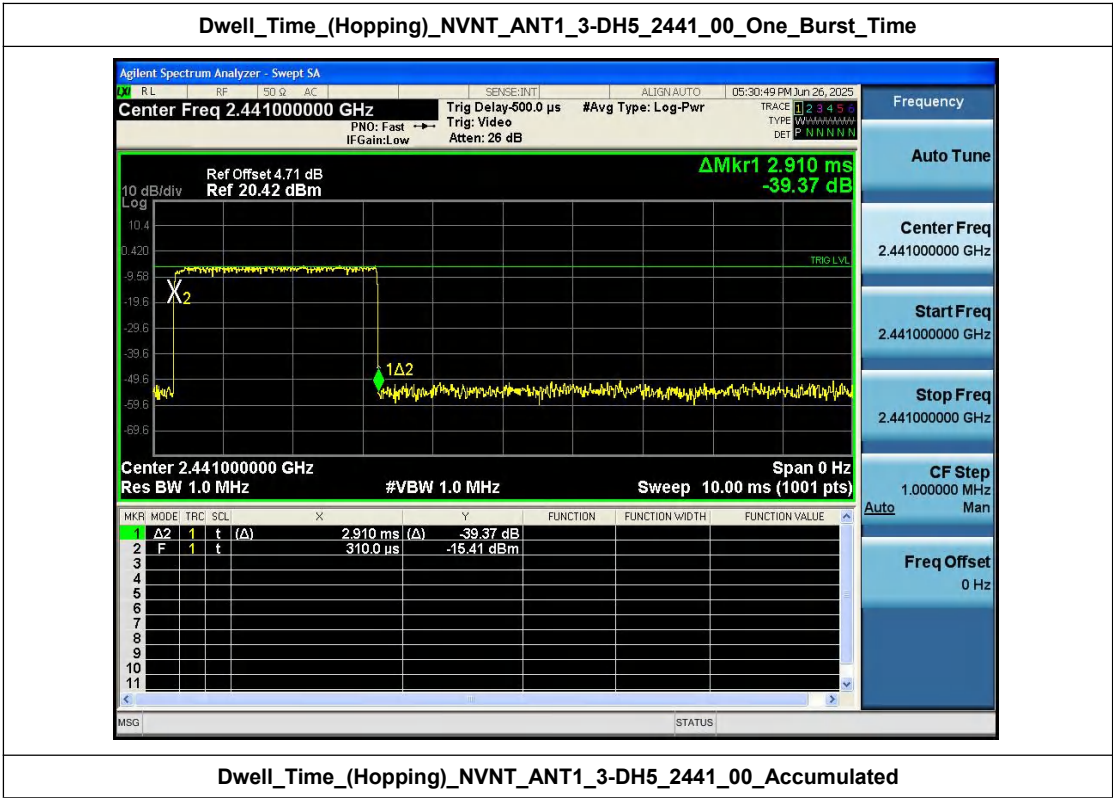


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH5_2441_00_Accumulated

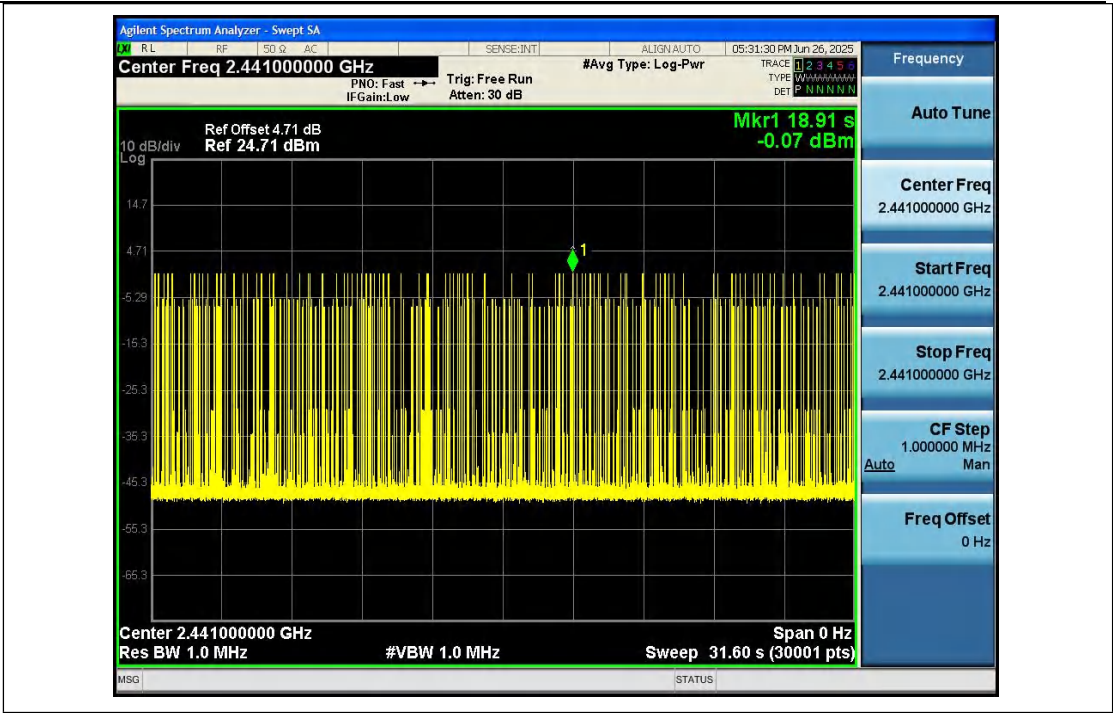


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH1_2441_00_One_Burst_Time

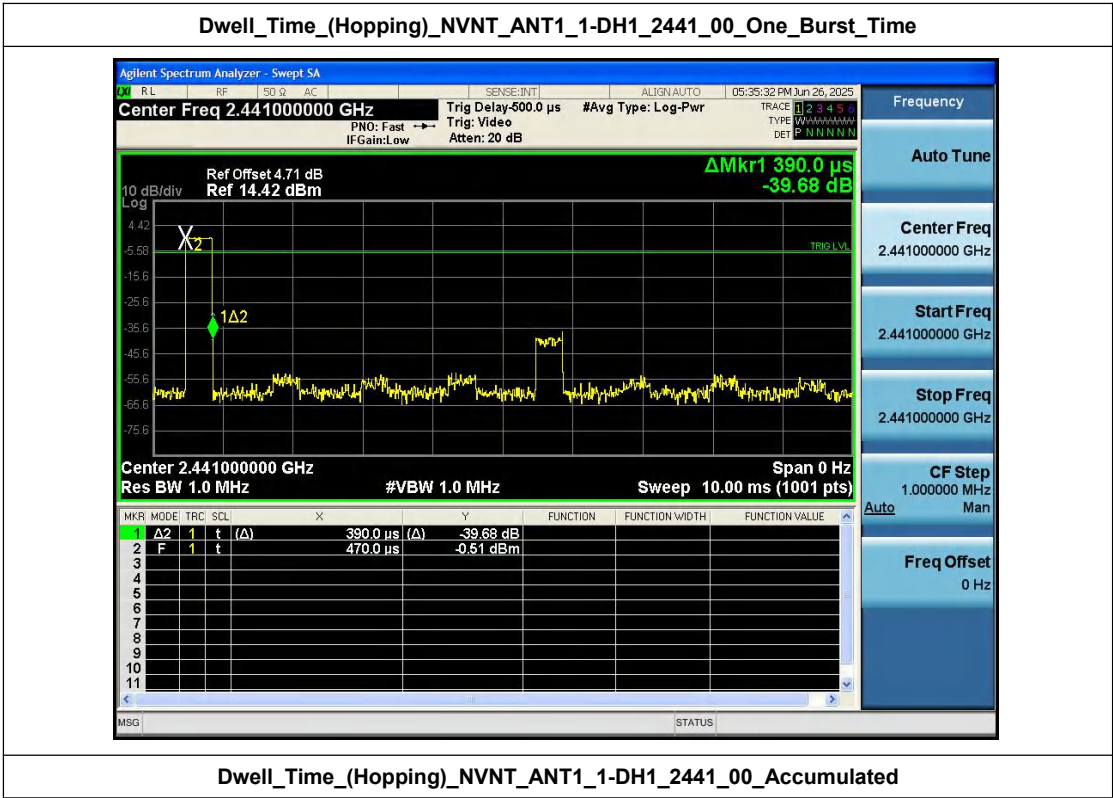


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH1_2441_00_Accumulated

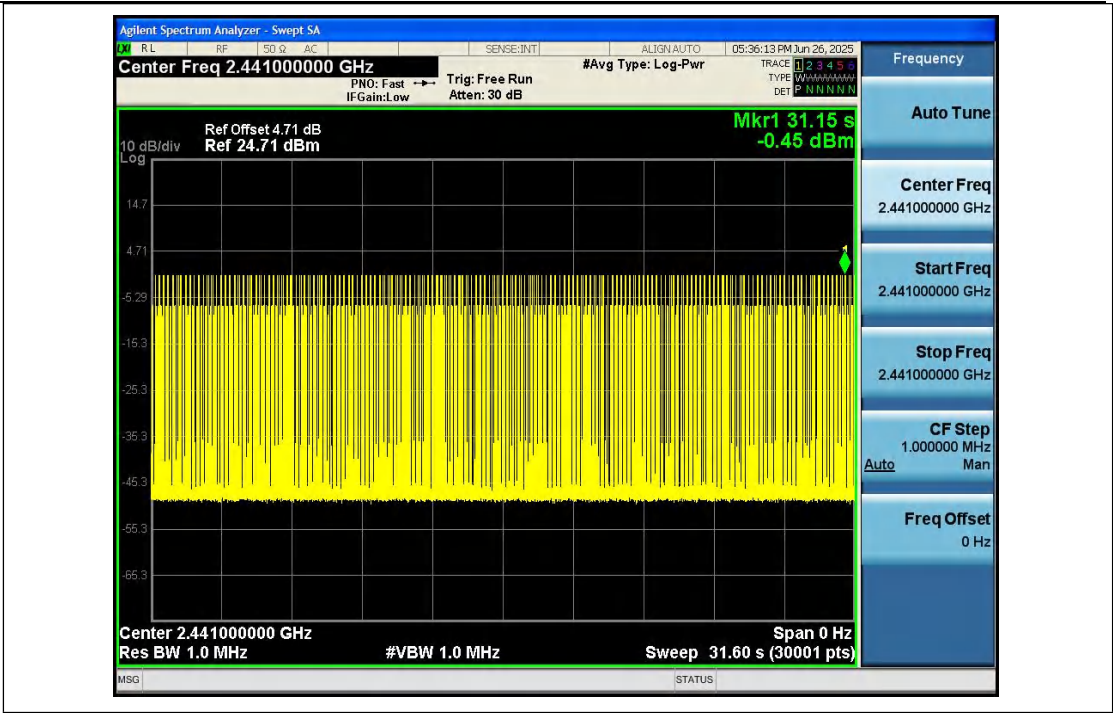


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH3_2441_00_One_Burst_Time

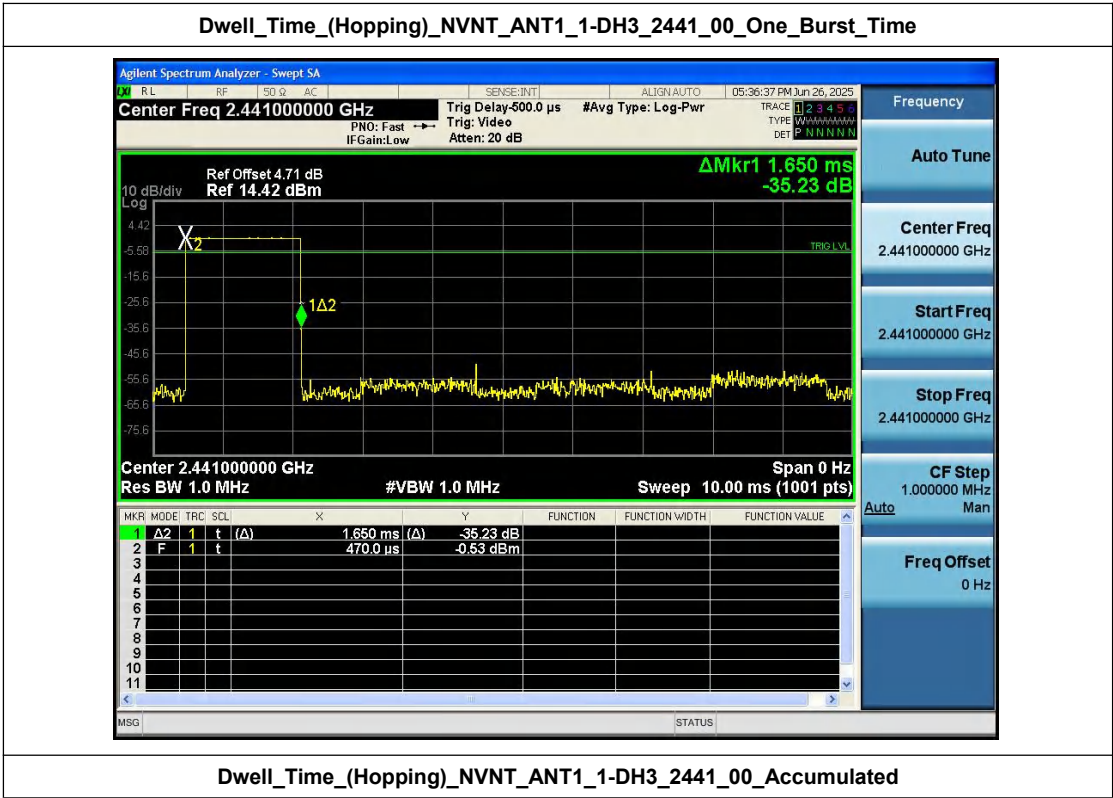


Dwell_Time_(Hopping)_NVNT_ANT1_1-DH3_2441_00_Accumulated

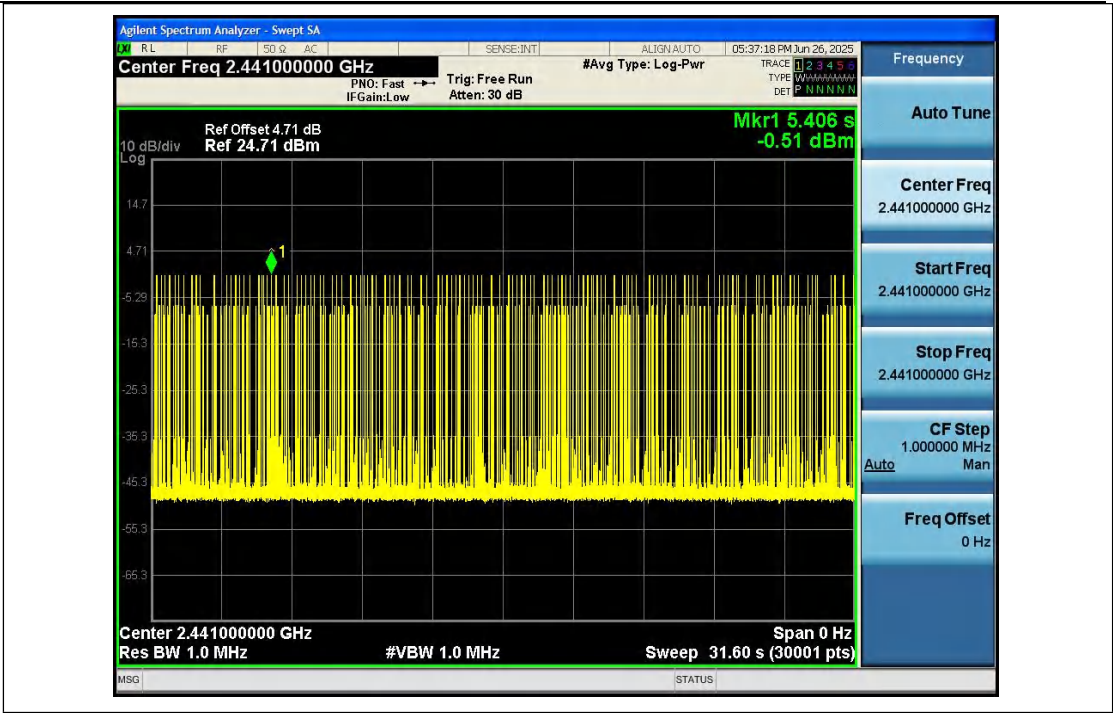


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH1_2441_00_One_Burst_Time

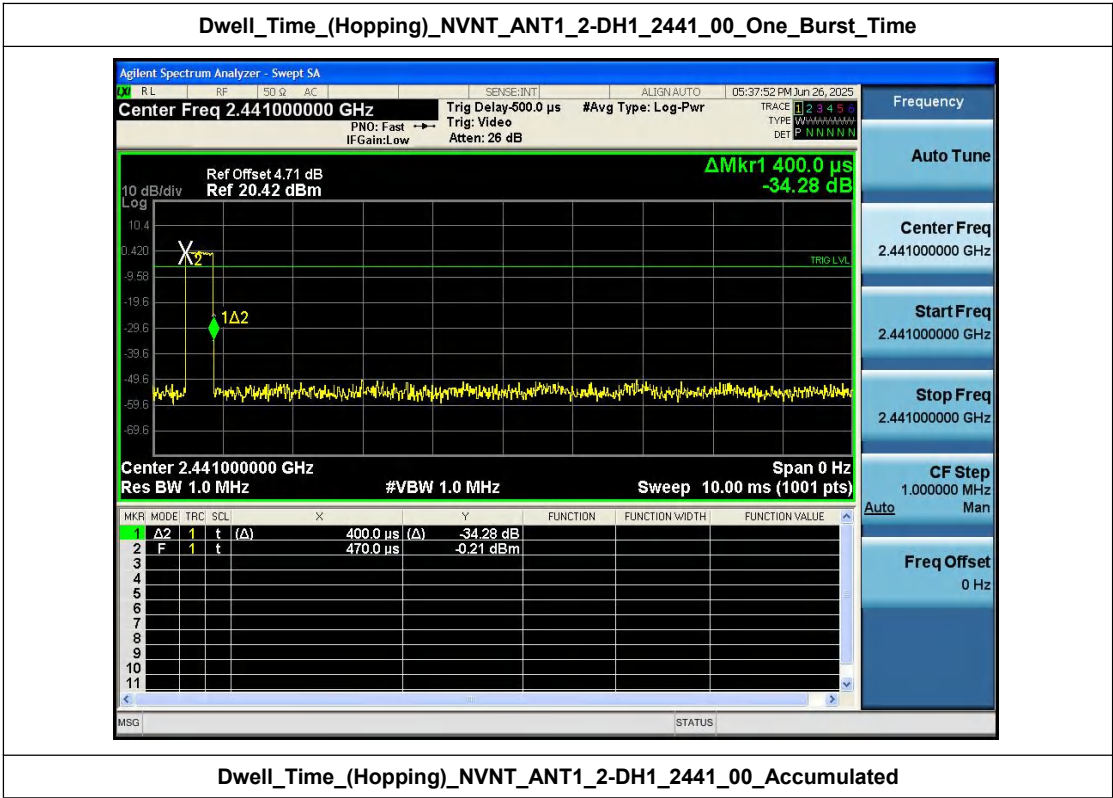


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH1_2441_00_Accumulated

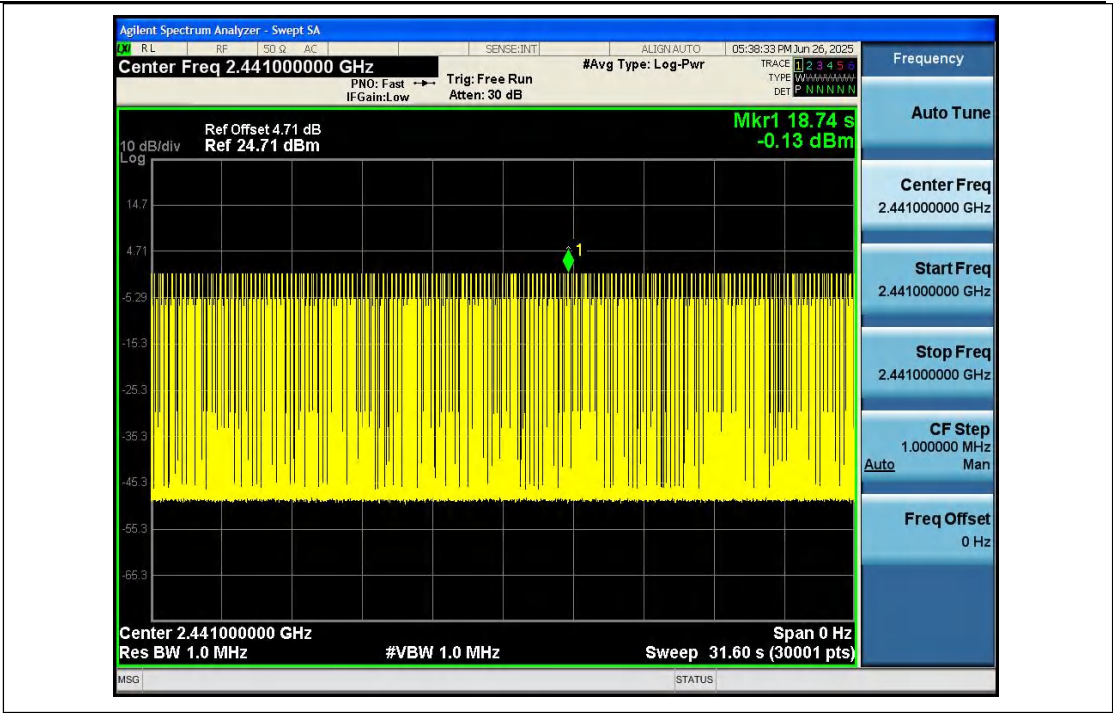


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH3_2441_00_One_Burst_Time

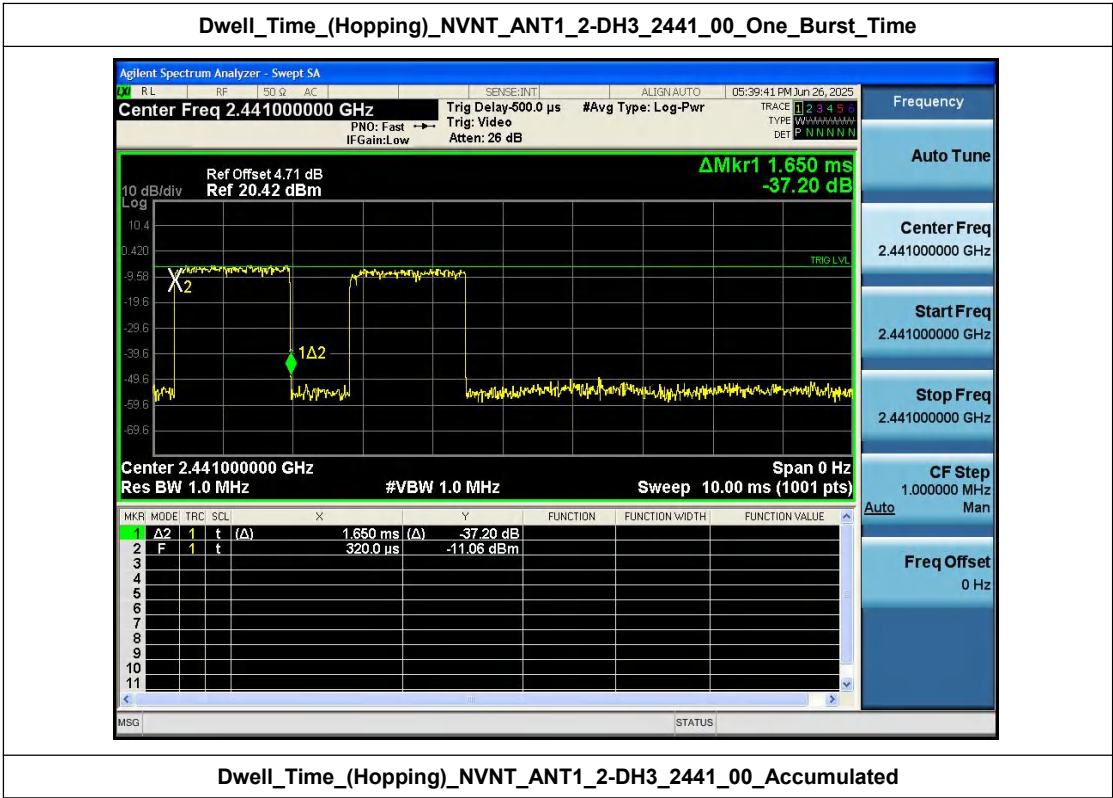


Dwell_Time_(Hopping)_NVNT_ANT1_2-DH3_2441_00_Accumulated

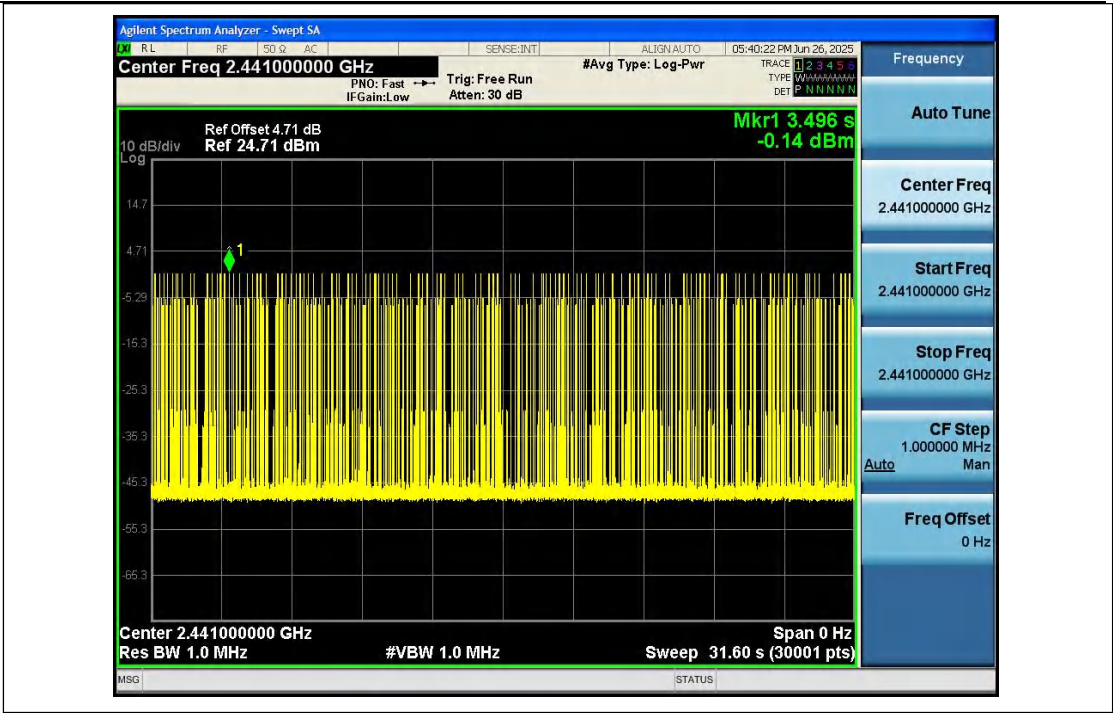


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH1_2441_00_One_Burst_Time

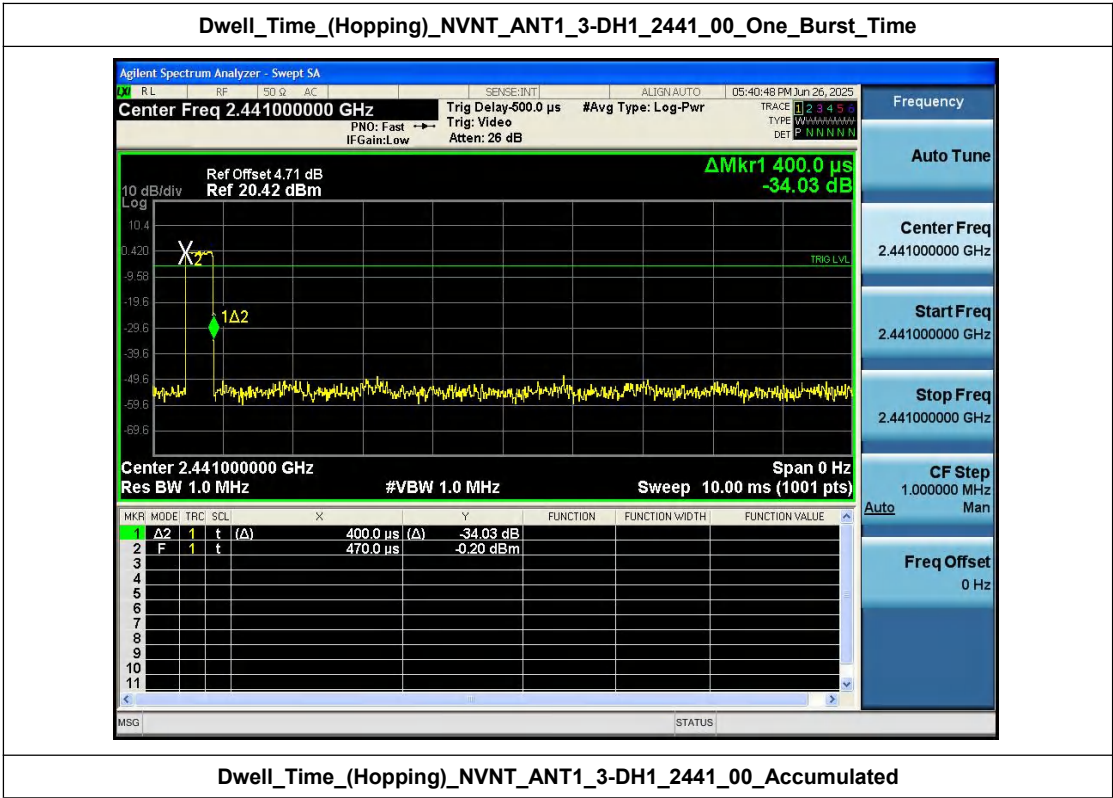


Dwell_Time_(Hopping)_NVNT_ANT1_3-DH1_2441_00_Accumulated

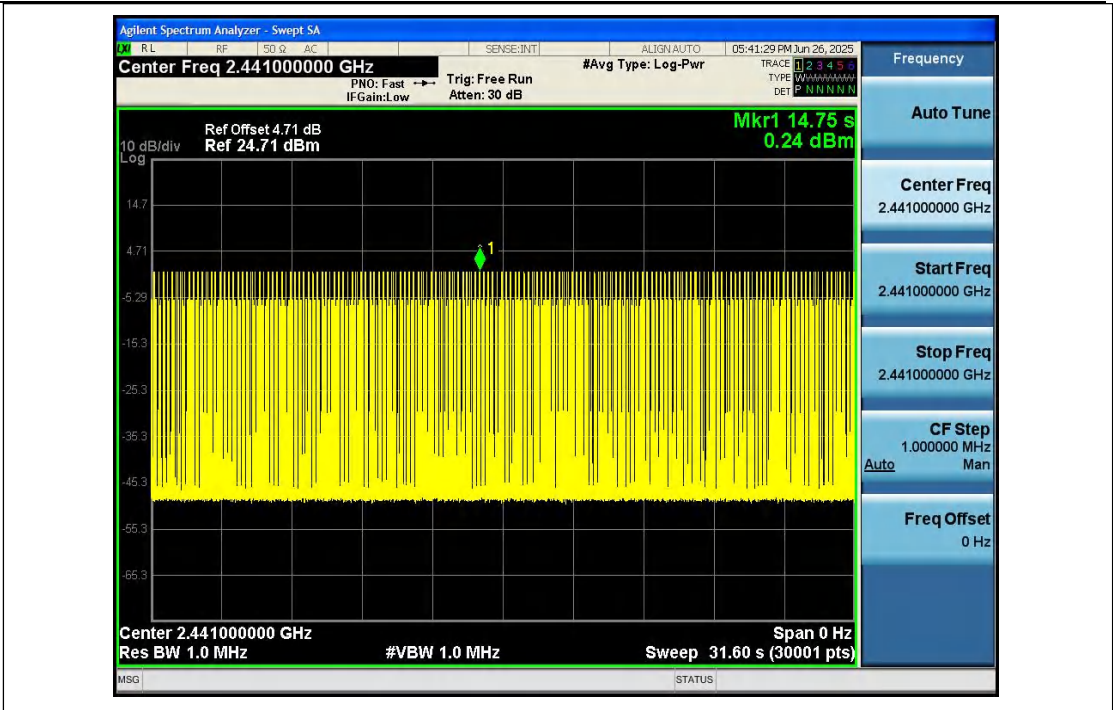

Dwell_Time_(Hopping)_NVNT_ANT1_3-DH3_2441_00_One_Burst_Time

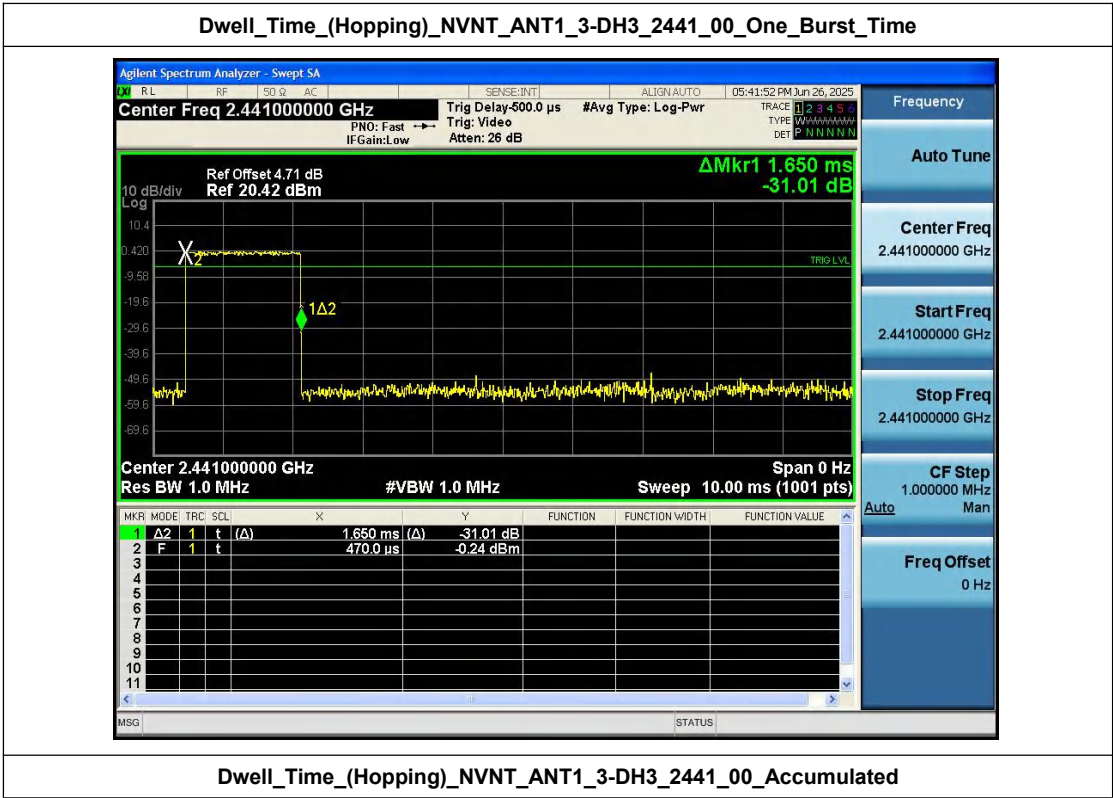

Dwell_Time_(Hopping)_NVNT_ANT1_3-DH3_2441_00_Accumulated

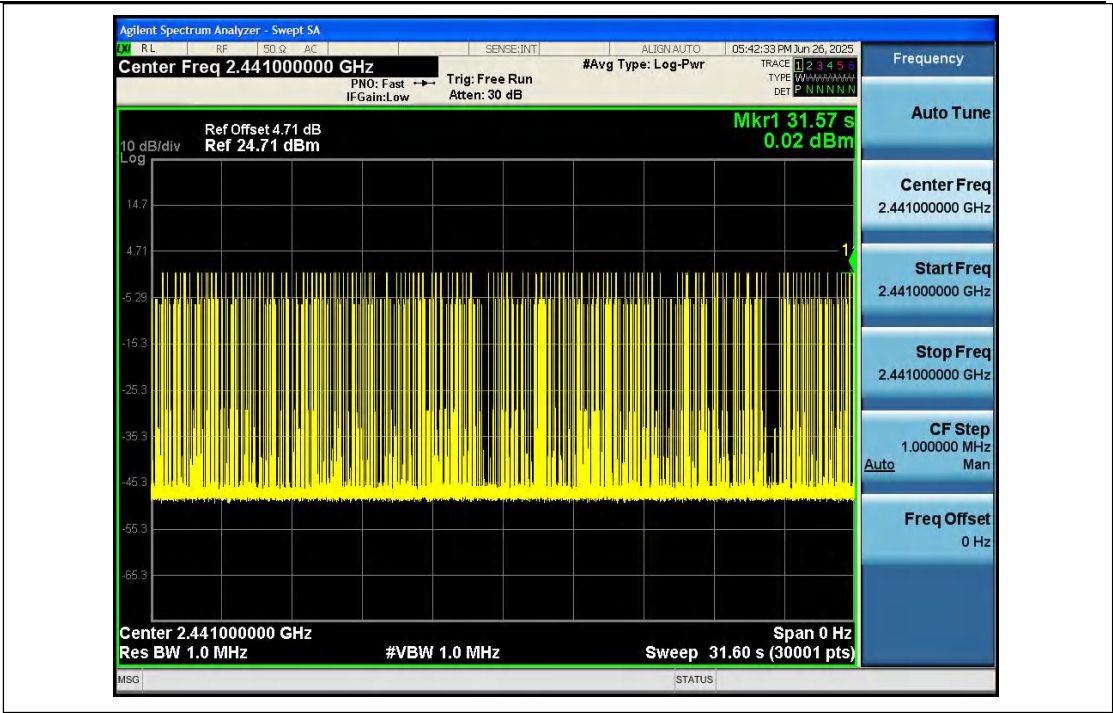

---END---

Shenzhen Anbotek Compliance Laboratory Limited

Any unauthorized modification, forgery, or falsification of this document constitutes a violation of law and is subject to legal penalties. If you have any questions, you may scan the QR code to download the report for verification or contact us via email.

Hotline: 400-003-0500 web: www.anbotek.com E-mail: service@anbotek.com