



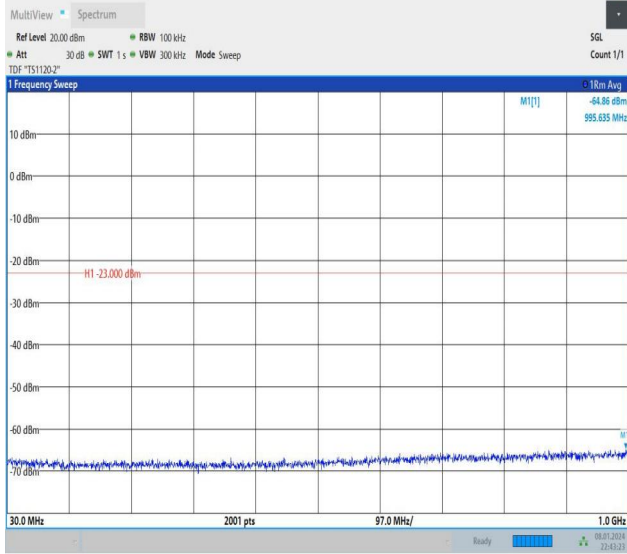


22:43:24 08.01.2024

Band2_15MHz_16QAM_18675_1RB#74_30~1000_30~1000

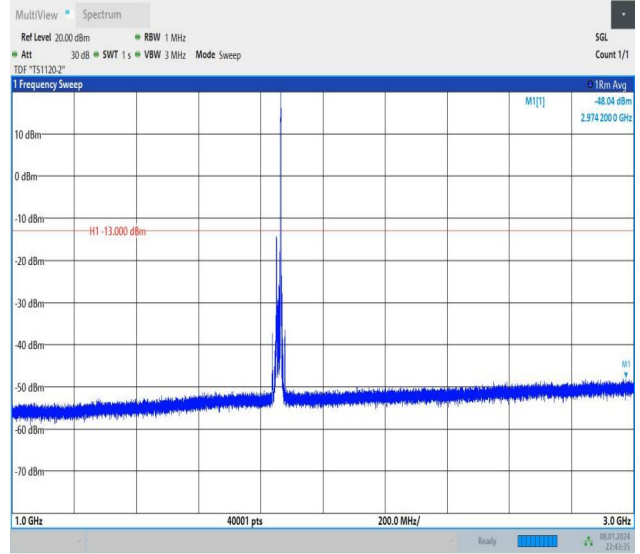


22:43:35 08.01.2024

Band2_15MHz_16QAM_18675_1RB#74_1000~3000_1000~3000

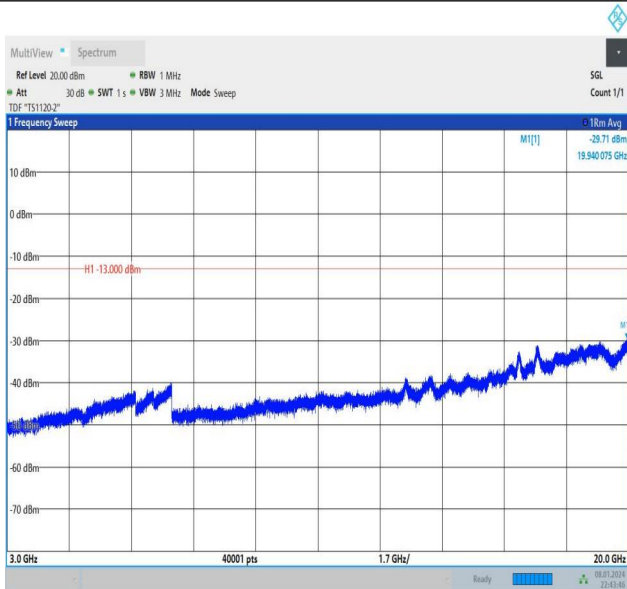


22:43:47 08.01.2024

Band2_15MHz_16QAM_18675_1RB#74_3000~20000_3000~20000

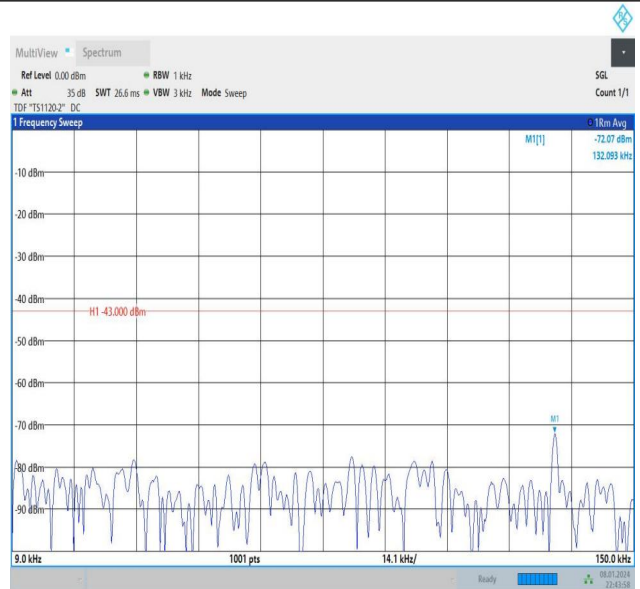


22:43:59 08.01.2024

Band2_15MHz_QPSK_18900_1RB#0_0.009~0.15_0.009~0.15

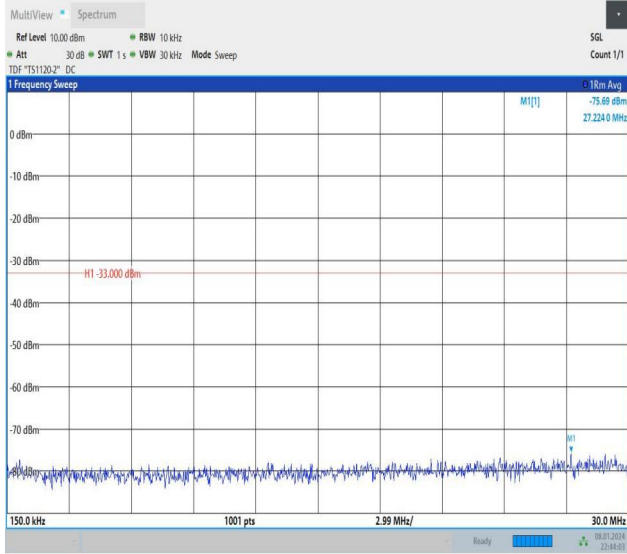


22:44:03 08.01.2024

Band2_15MHz_QPSK_18900_1RB#0_0.15~30_0.15~30

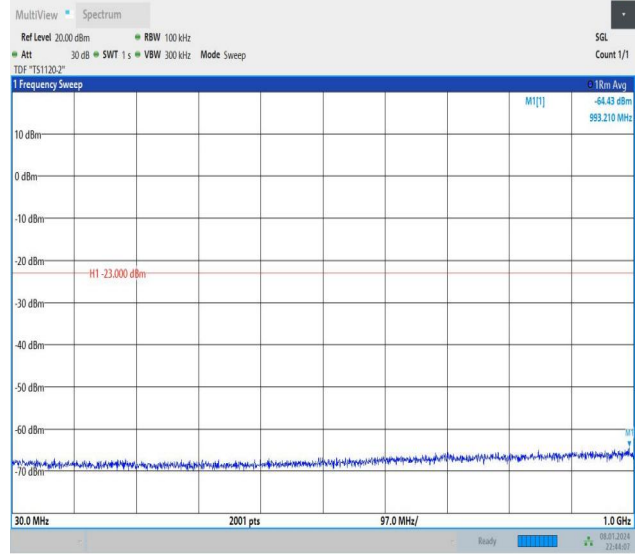

22:44:08 08.01.2024


Band2_15MHz_QPSK_18900_1RB#0_30~1000_30~1000

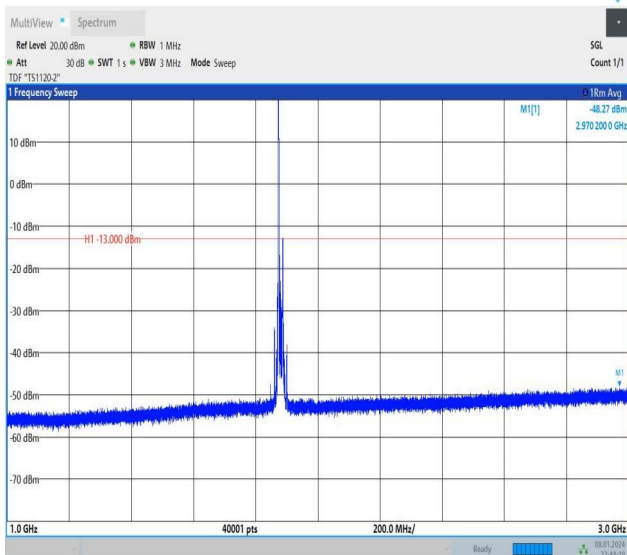

22:44:20 08.01.2024

Band2_15MHz_QPSK_18900_1RB#0_1000~3000_1000~300


0

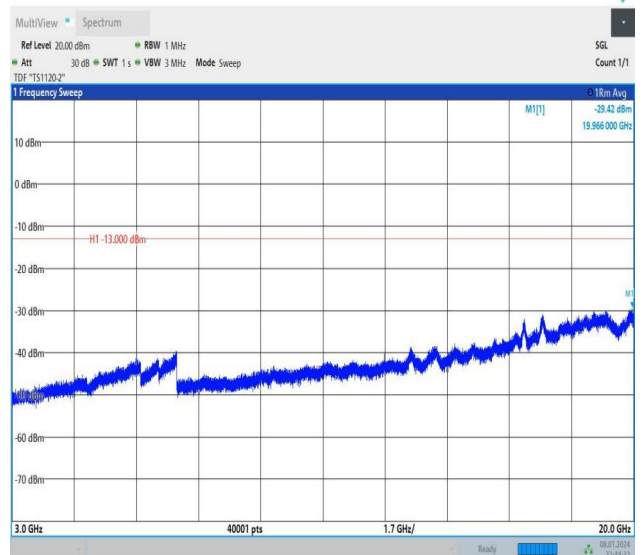

22:44:32 08.01.2024


Band2_15MHz_QPSK_18900_1RB#0_3000~20000_3000~20

000

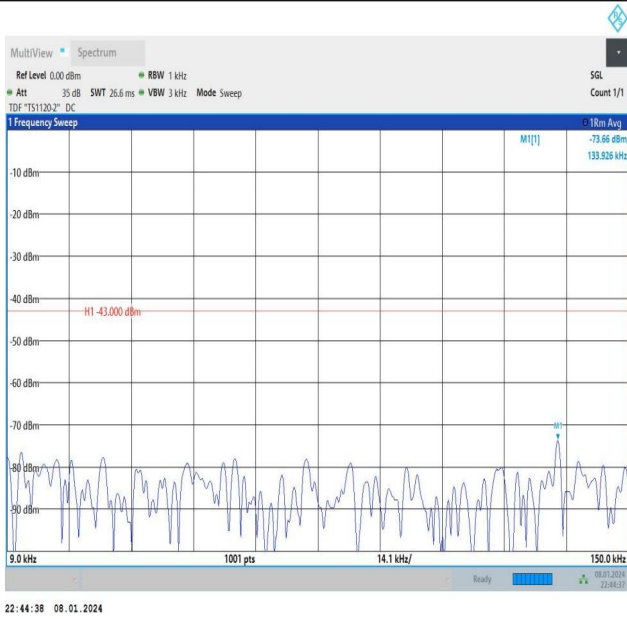


Band2_15MHz_16QAM_18900_1RB#0_0.009~0.15_0.009~0.


15

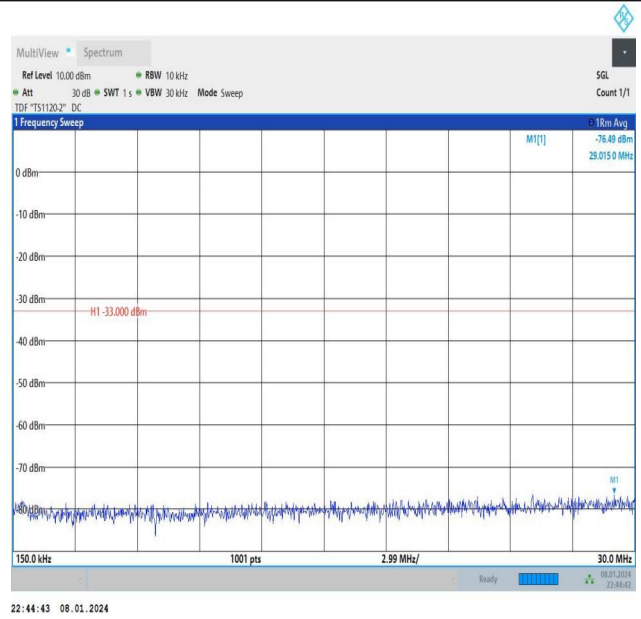

Band2_15MHz_16QAM_18900_1RB#0_0.15~30_0.15~30

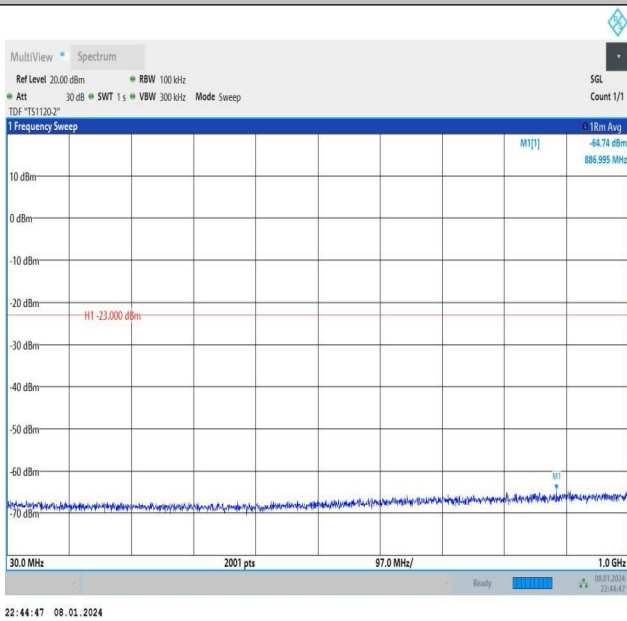


Band2_15MHz_16QAM_18900_1RB#0_30~1000_30~1000

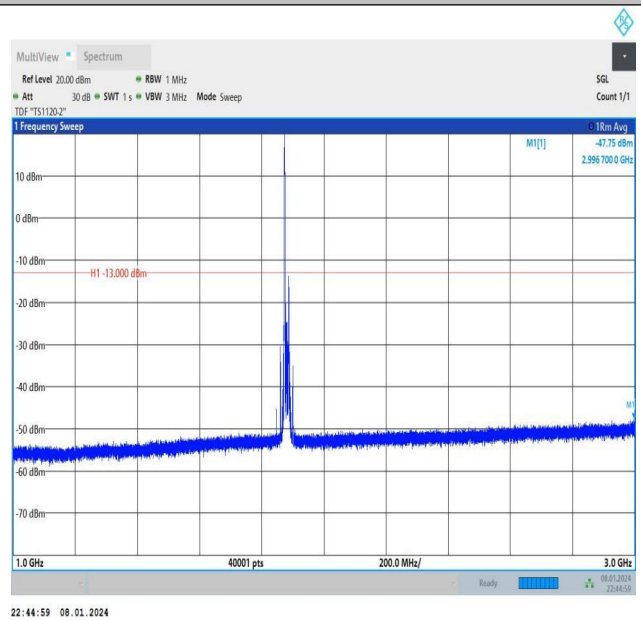


Band2_15MHz_16QAM_18900_1RB#0_1000~3000_1000~30

00

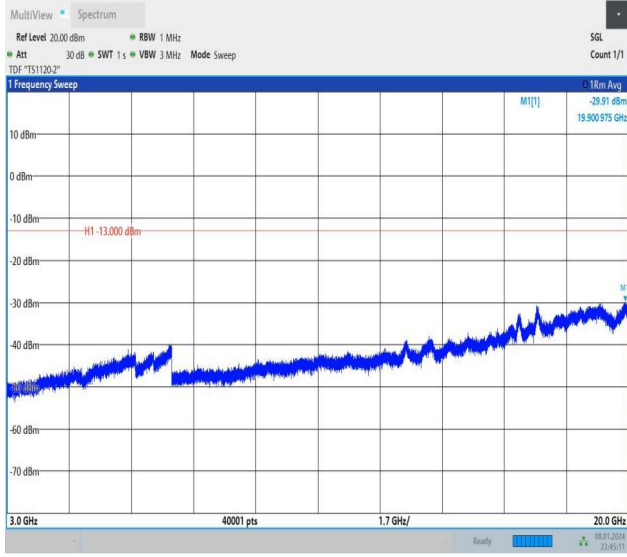


22:45:11 08.01.2024

Band2_15MHz_16QAM_18900_1RB#0_3000~20000_3000~20000

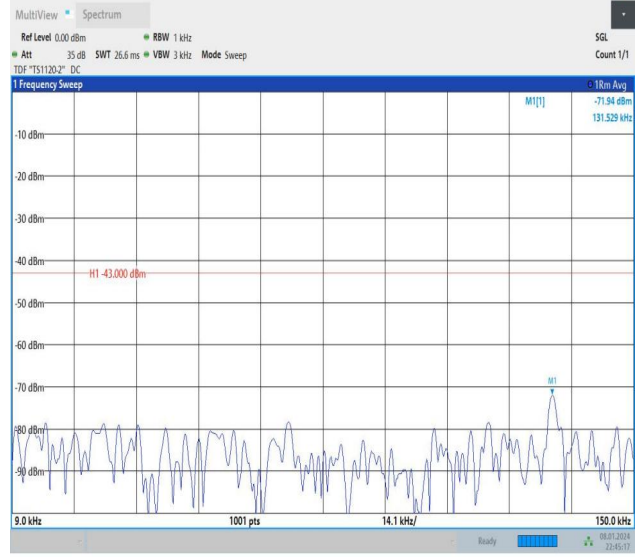


22:45:18 08.01.2024

Band2_15MHz_QPSK_18900_1RB#74_0.009~0.15_0.009~0.15

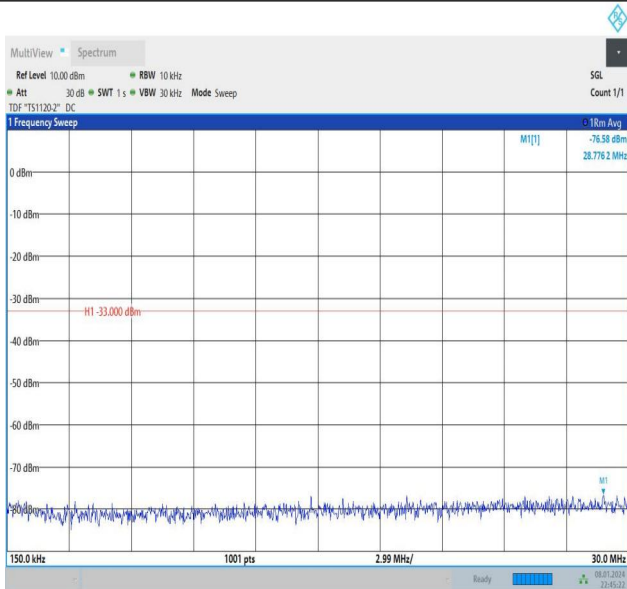


22:45:22 08.01.2024

Band2_15MHz_QPSK_18900_1RB#74_0.15~30_0.15~30

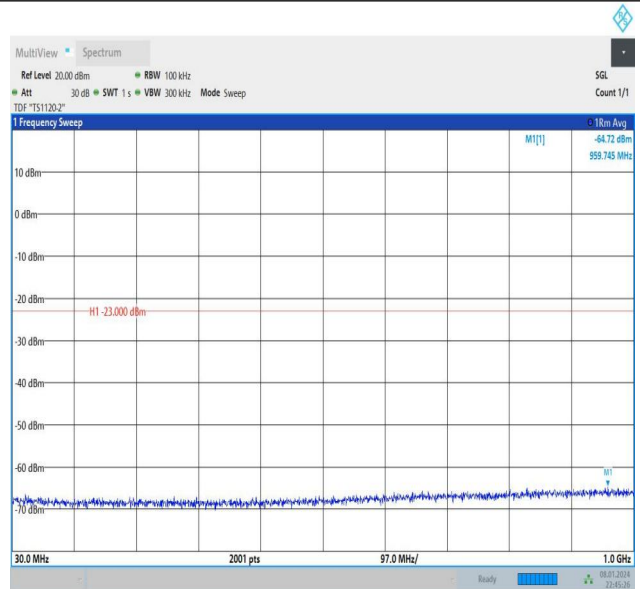

22:45:27 08.01.2024


Band2_15MHz_QPSK_18900_1RB#74_30~1000_30~1000

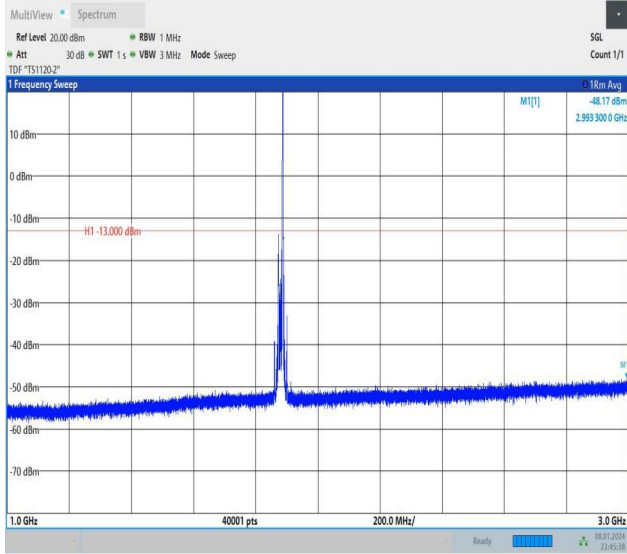

22:45:39 08.01.2024

Band2_15MHz_QPSK_18900_1RB#74_1000~3000_1000~30


00

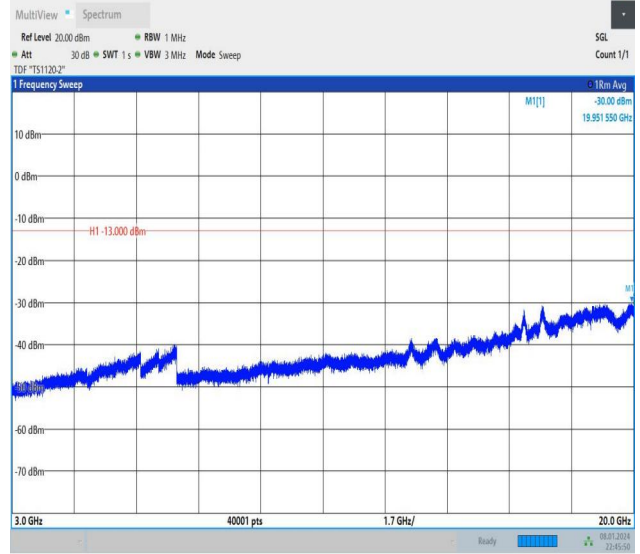

22:45:50 08.01.2024

Band2_15MHz_QPSK_18900_1RB#74_3000~20000_3000~2


0000

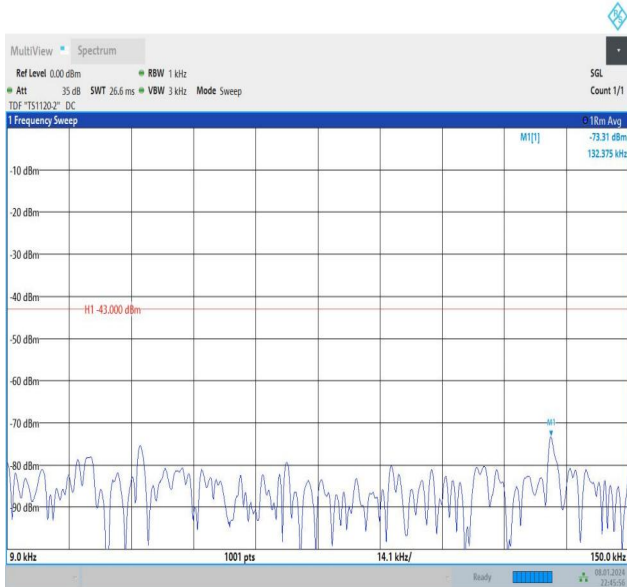

22:45:57 08.01.2024


Band2_15MHz_16QAM_18900_1RB#74_0.009~0.15_0.009~0

.15

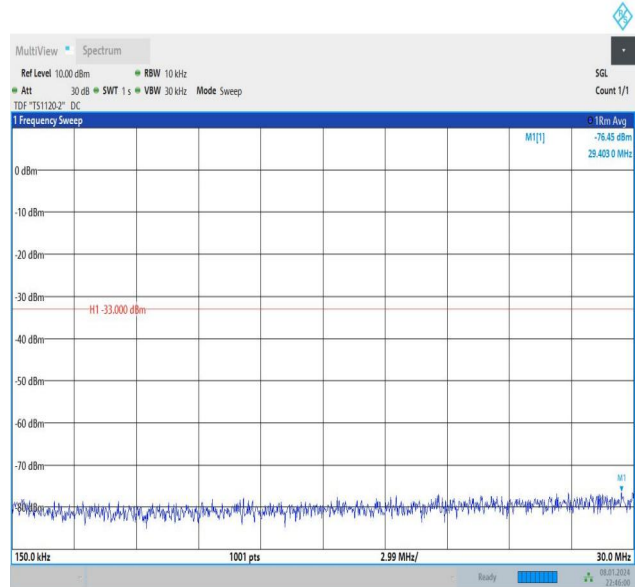


22:46:01 08.01.2024

Band2_15MHz_16QAM_18900_1RB#74_0.15~30_0.15~30

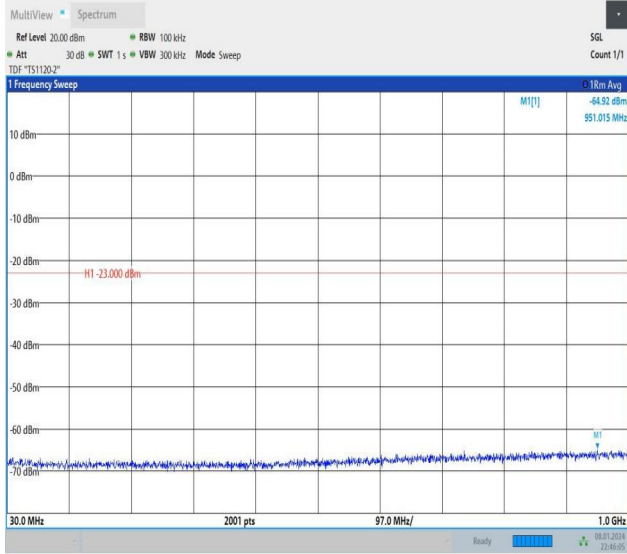


22:46:06 08.01.2024

Band2_15MHz_16QAM_18900_1RB#74_30~1000_30~1000

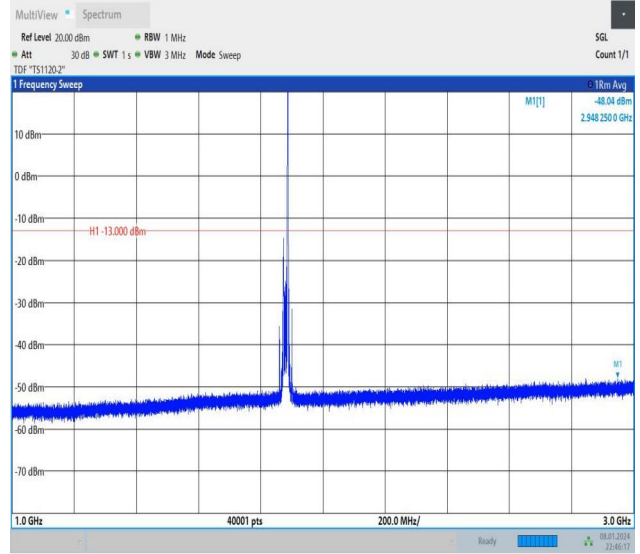


22:46:18 08.01.2024

Band2_15MHz_16QAM_18900_1RB#74_1000~3000_1000~3000

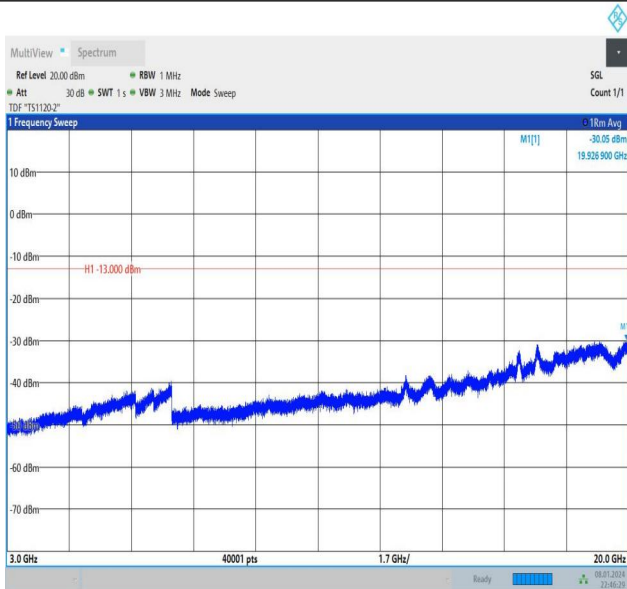

22:46:30 08.01.2024


Band2_15MHz_16QAM_18900_1RB#74_3000~20000_3000~20000

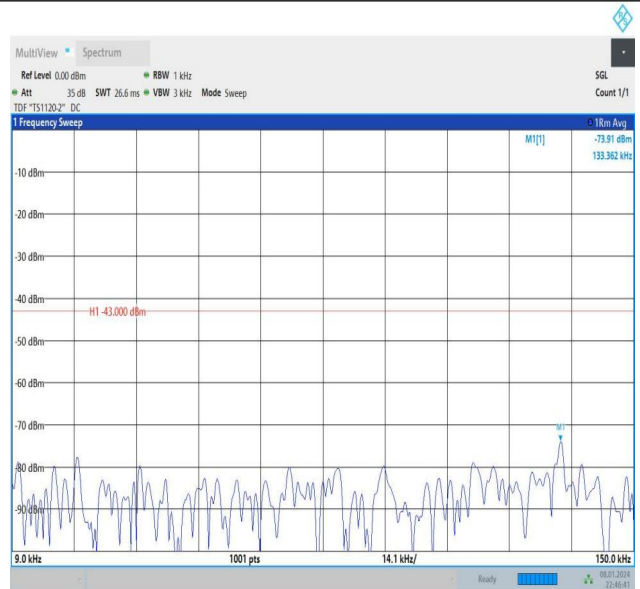

22:46:41 08.01.2024


Band2_15MHz_QPSK_19125_1RB#0_0.009~0.15_0.009~0.15

5

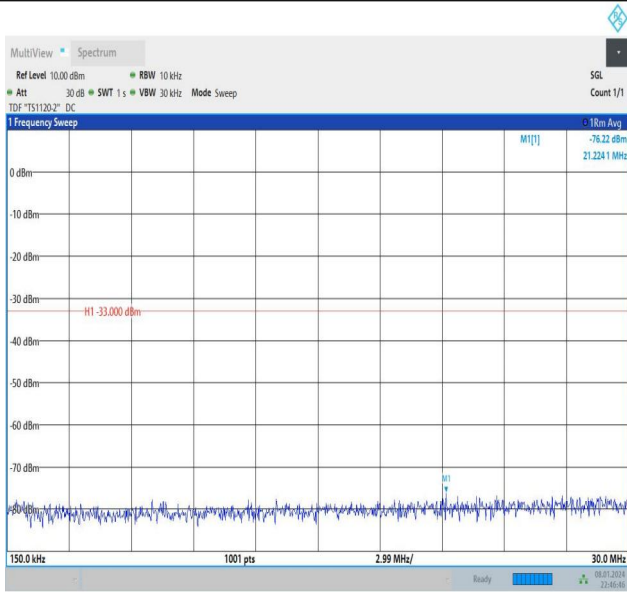


22:46:46 08.01.2024

Band2_15MHz_QPSK_19125_1RB#0_0.15~30_0.15~30

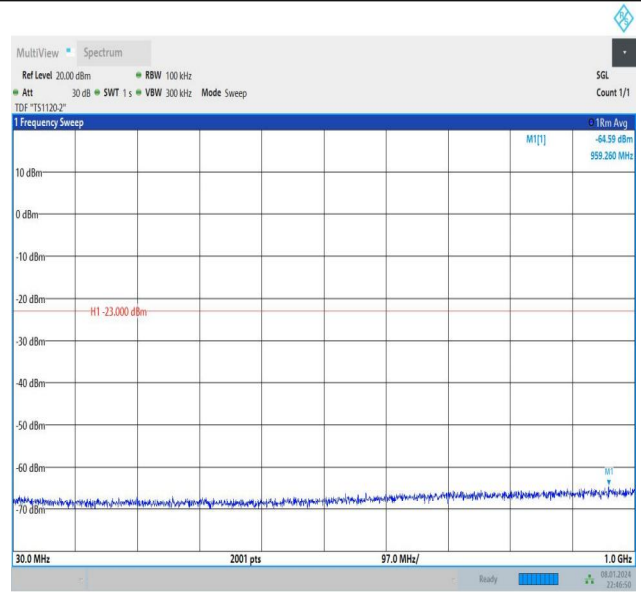

22:46:51 08.01.2024


Band2_15MHz_QPSK_19125_1RB#0_30~1000_30~1000

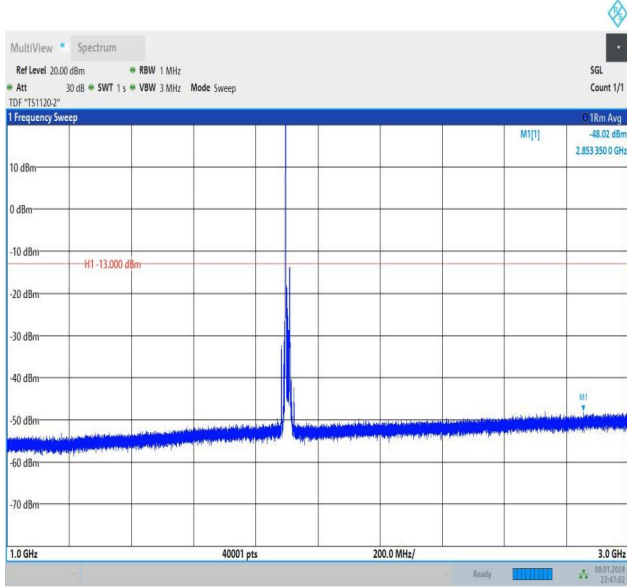

22:47:02 08.01.2024

Band2_15MHz_QPSK_19125_1RB#0_1000~3000_1000~300


0

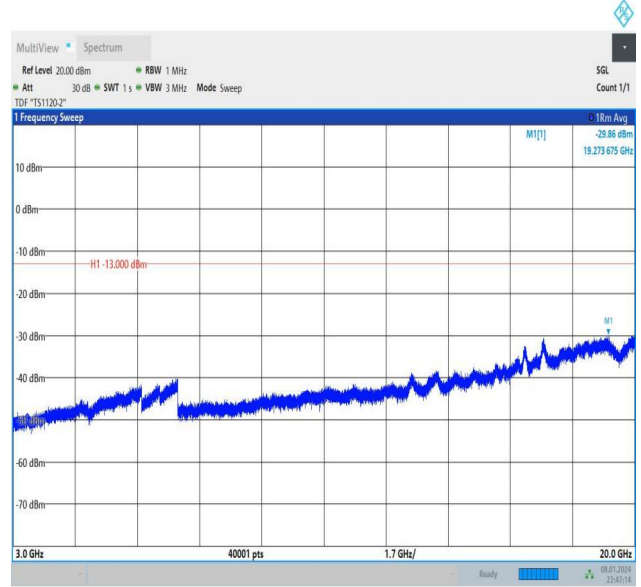

22:47:14 08.01.2024


Band2_15MHz_QPSK_19125_1RB#0_3000~20000_3000~20

000

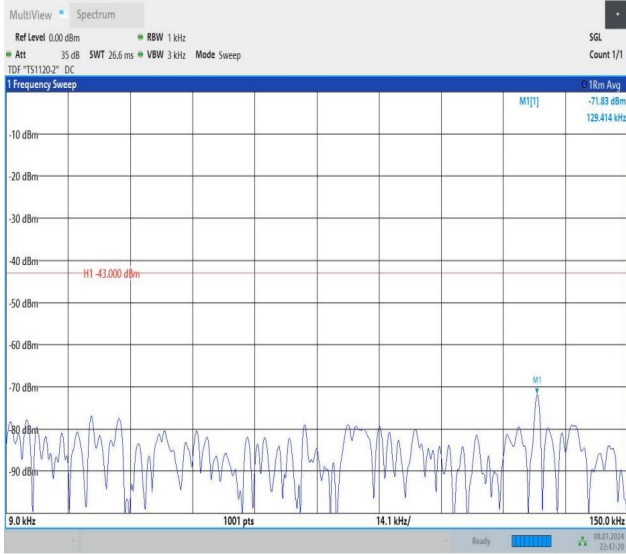


Band2_15MHz_16QAM_19125_1RB#0_0.009~0.15_0.009~0.


15

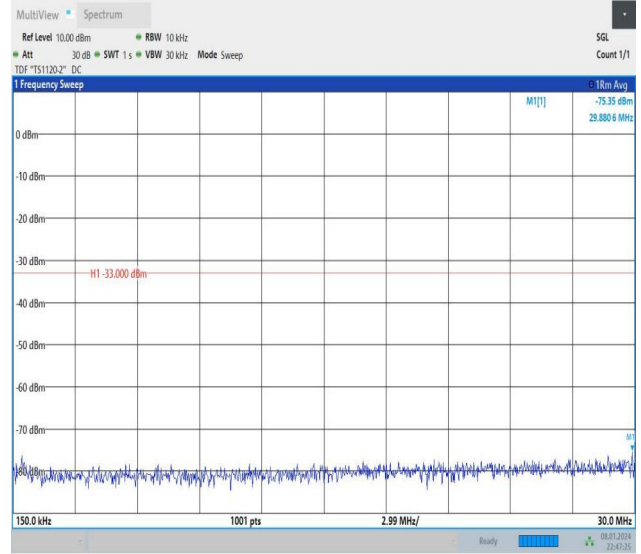

Band2_15MHz_16QAM_19125_1RB#0_0.15~30_0.15~30

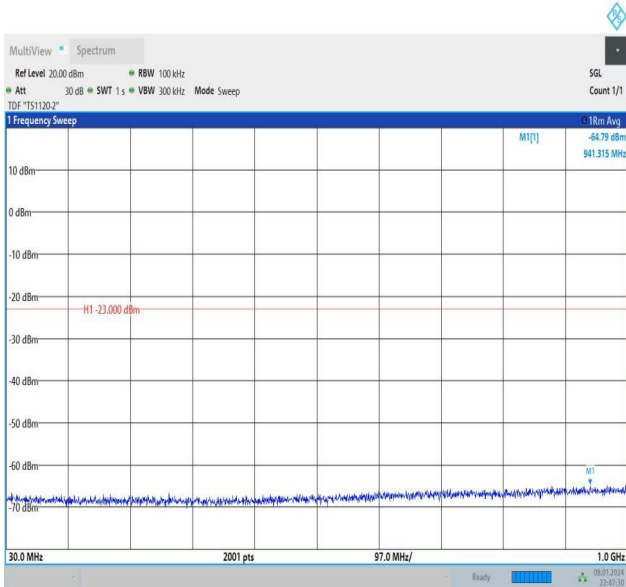


Band2_15MHz_16QAM_19125_1RB#0_30~1000_30~1000

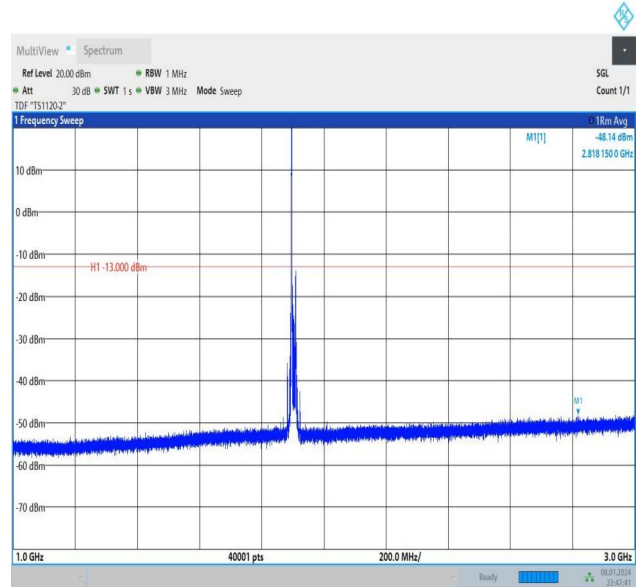


Band2_15MHz_16QAM_19125_1RB#0_1000~3000_1000~30


00

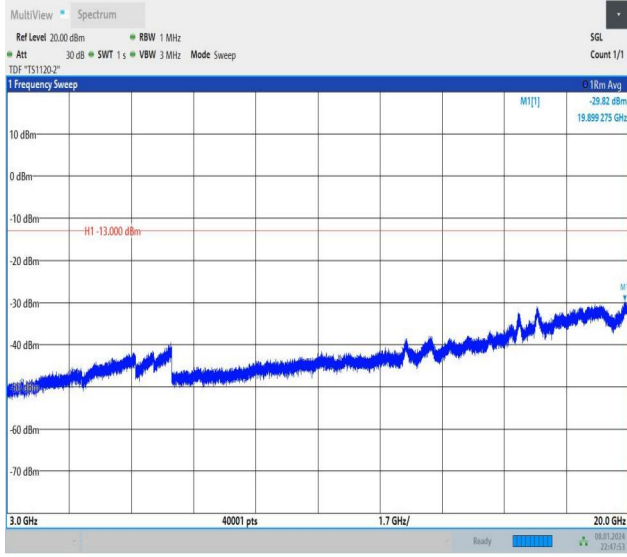


Band2_15MHz_16QAM_19125_1RB#0_3000~20000_3000~20000

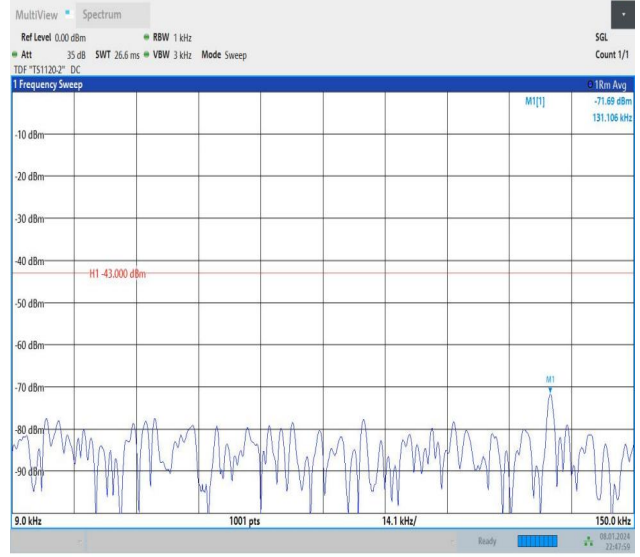


Band2_15MHz_QPSK_19125_1RB#74_0.009~0.15_0.009~0.15

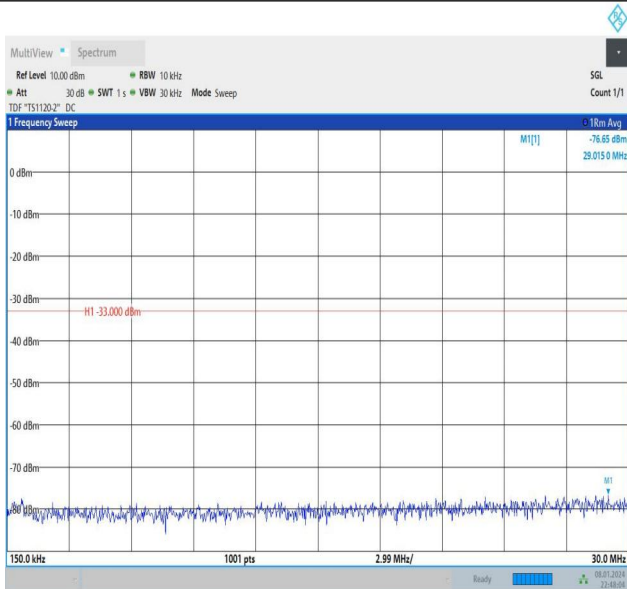

Band2_15MHz_QPSK_19125_1RB#74_0.15~30_0.15~30

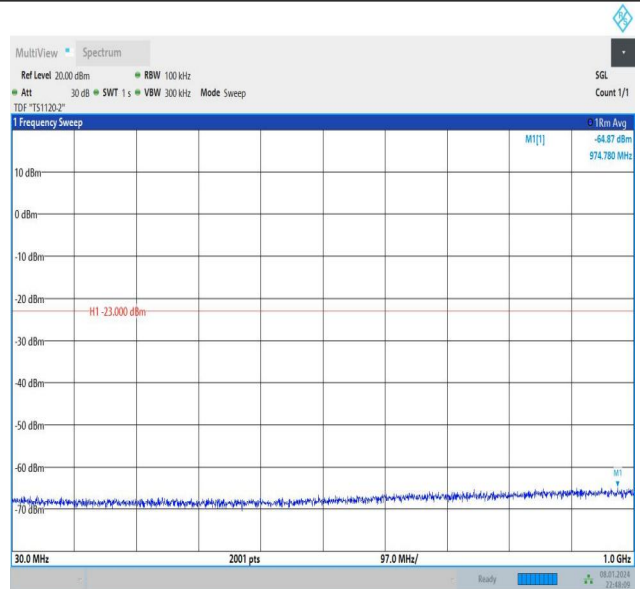


Band2_15MHz_QPSK_19125_1RB#74_30~1000_30~1000

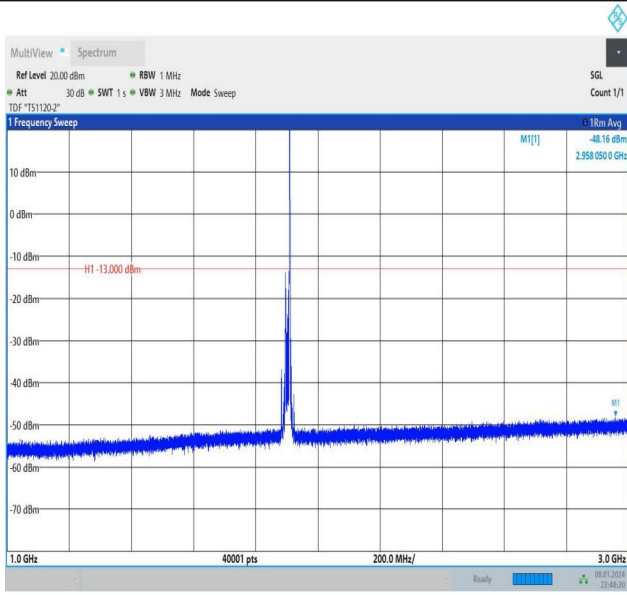


Band2_15MHz_QPSK_19125_1RB#74_1000~3000_1000~30

00

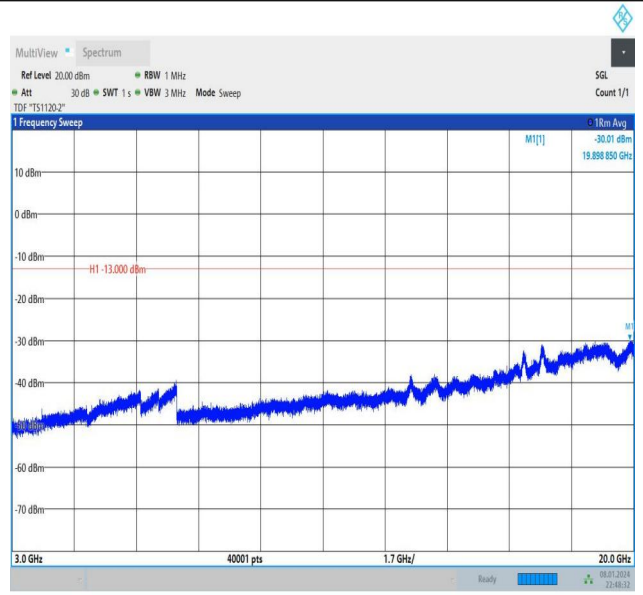


Band2_15MHz_QPSK_19125_1RB#74_3000~20000_3000~2

0000

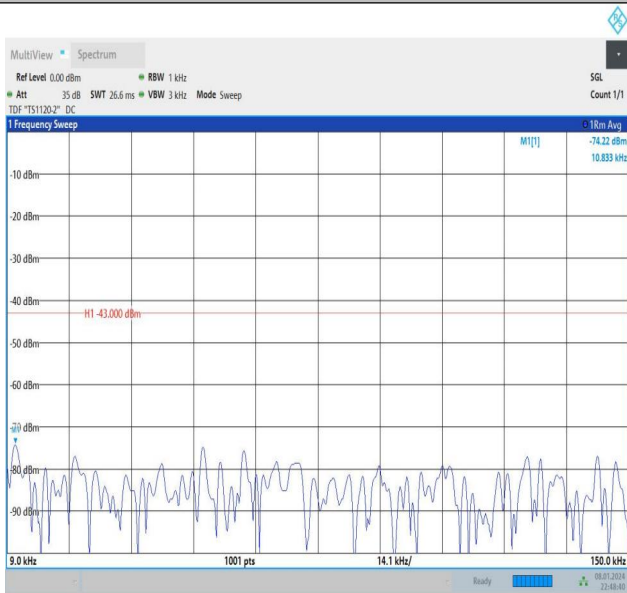


Band2_15MHz_16QAM_19125_1RB#74_0.009~0.15_0.009~0


.15

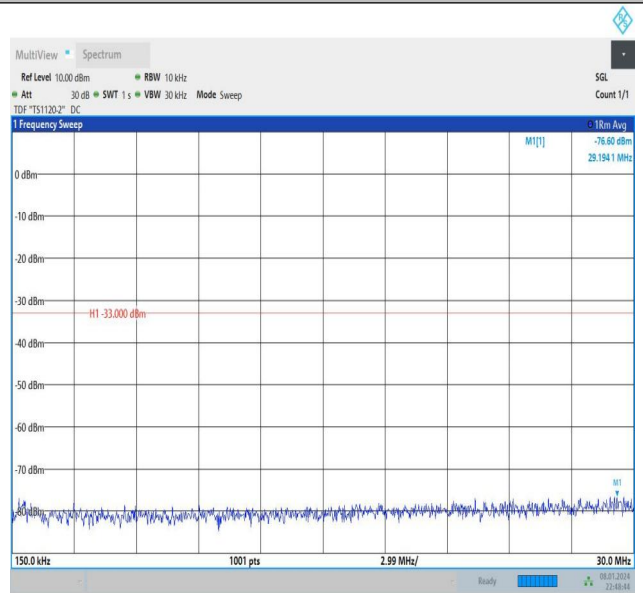


Band2_15MHz_16QAM_19125_1RB#74_0.15~30_0.15~30

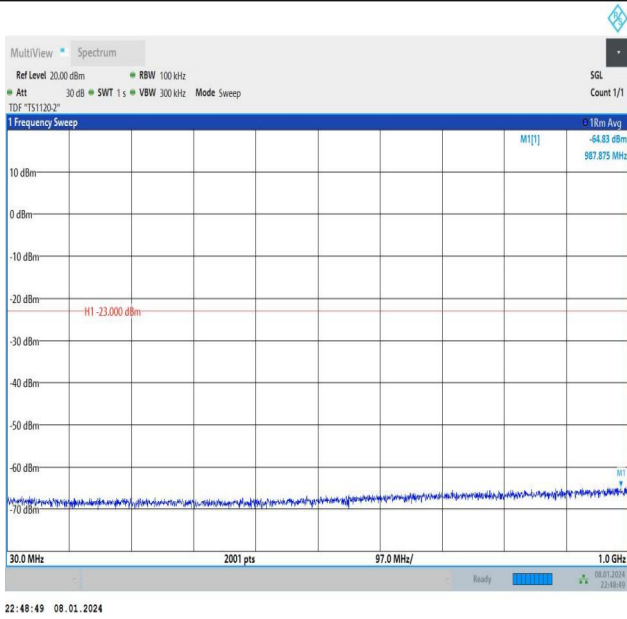


Band2_15MHz_16QAM_19125_1RB#74_30~1000_30~1000

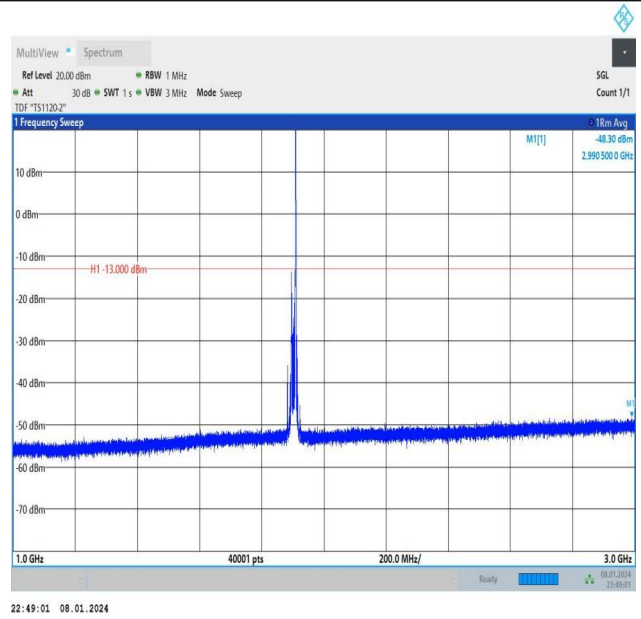


Band2_15MHz_16QAM_19125_1RB#74_1000~3000_1000~3000

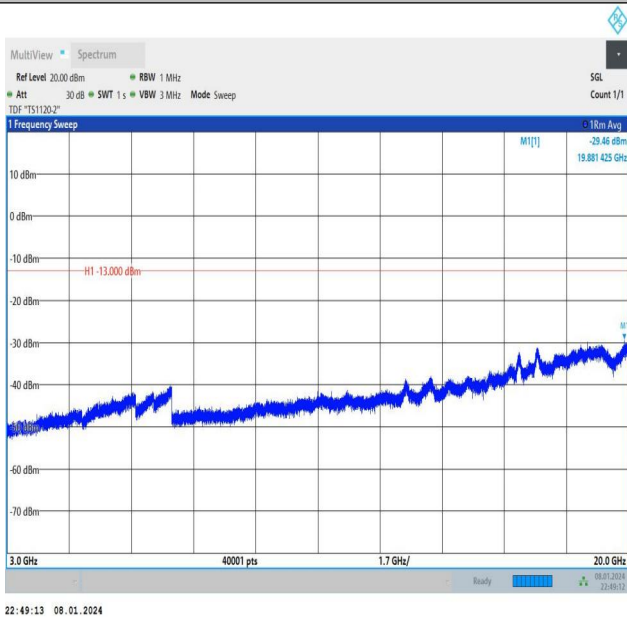


Band2_15MHz_16QAM_19125_1RB#74_3000~20000_3000~20000

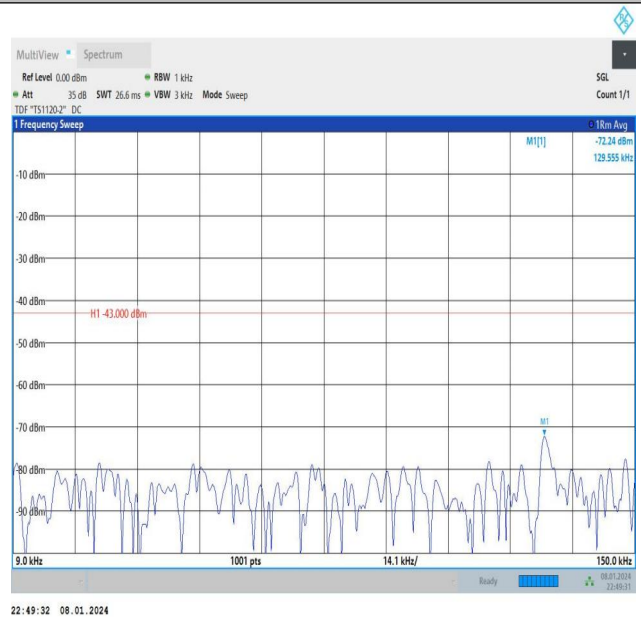


Band2_15MHz_QPSK_18675_75RB#0_0.009~0.15_0.009~0.15

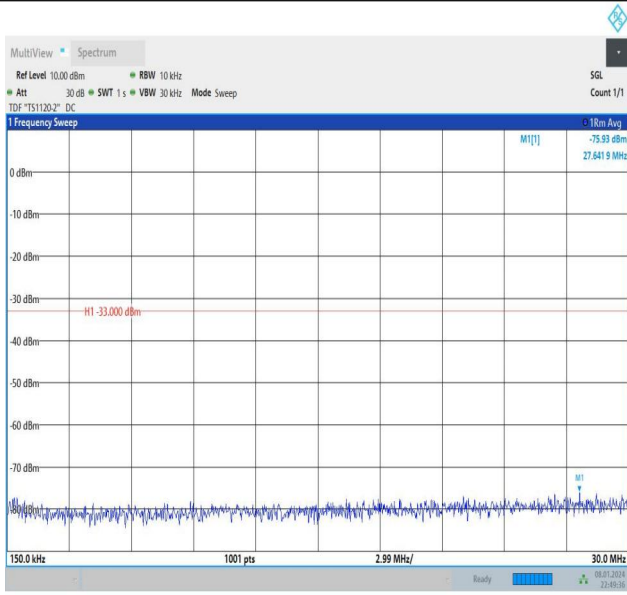


Band2_15MHz_QPSK_18675_75RB#0_0.15~30_0.15~30

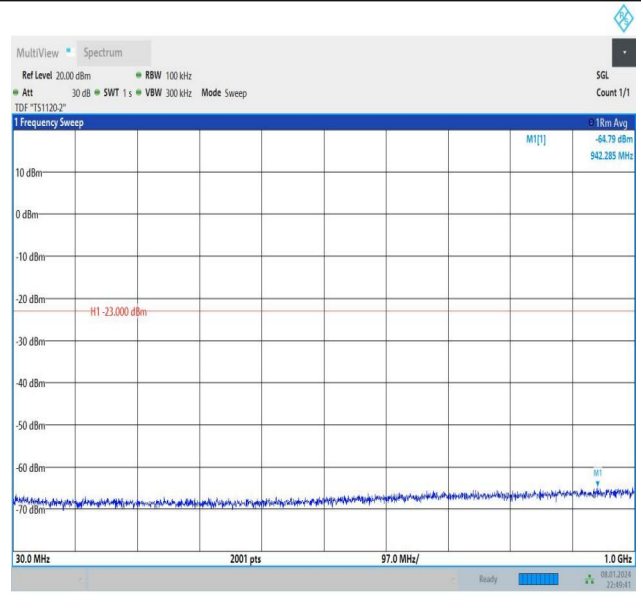


Band2_15MHz_QPSK_18675_75RB#0_30~1000_30~1000

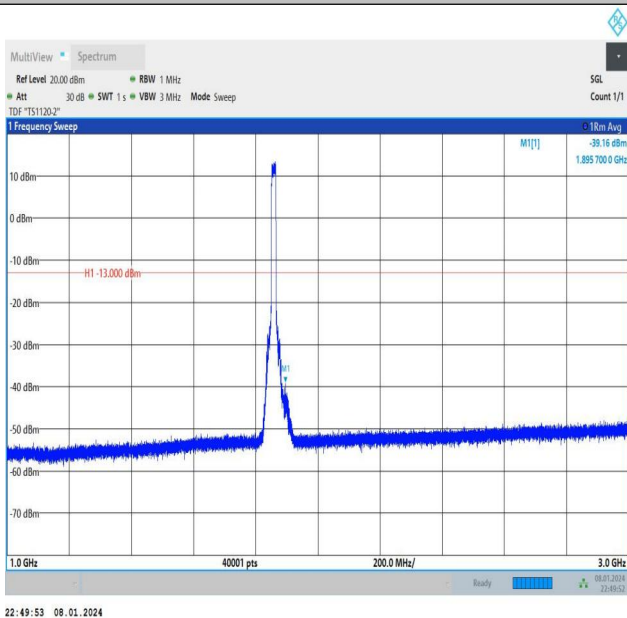

Band2_15MHz_QPSK_18675_75RB#0_1000~3000_1000~30
00

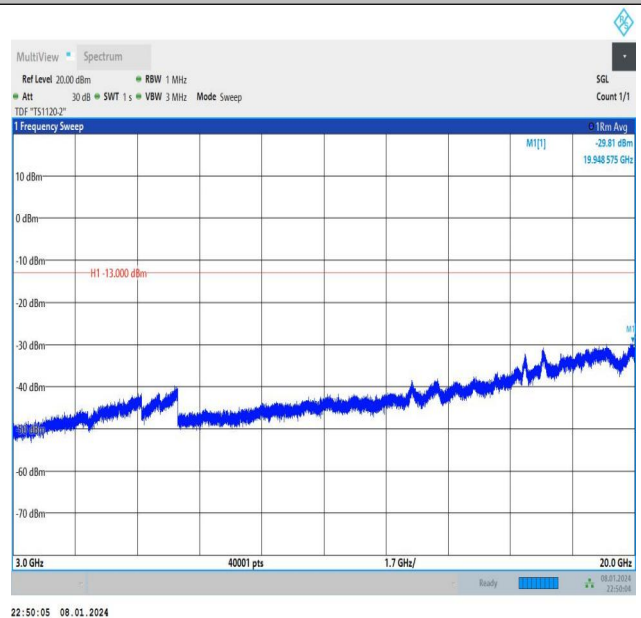


Band2_15MHz_QPSK_18675_75RB#0_3000~20000_3000~2
0000

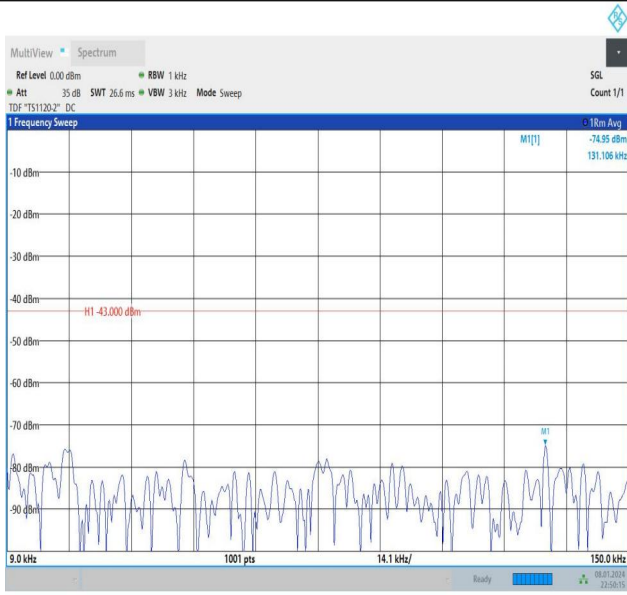


Band2_15MHz_QPSK_18900_75RB#0_0.009~0.15_0.009~0.


15

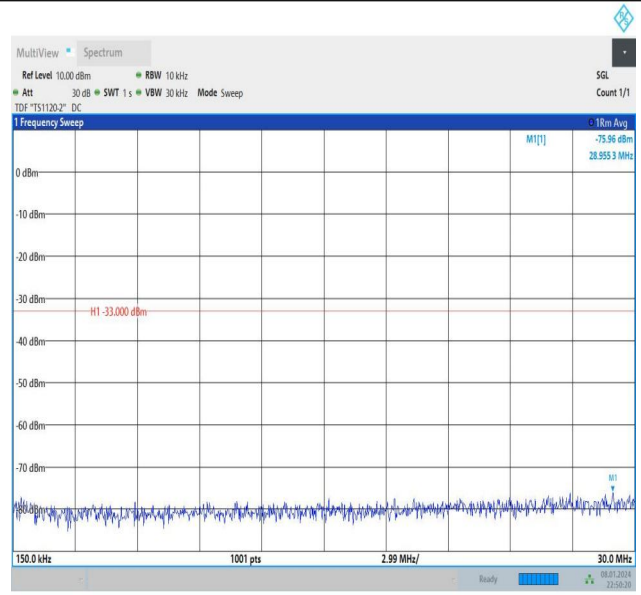

Band2_15MHz_QPSK_18900_75RB#0_0.15~30_0.15~30

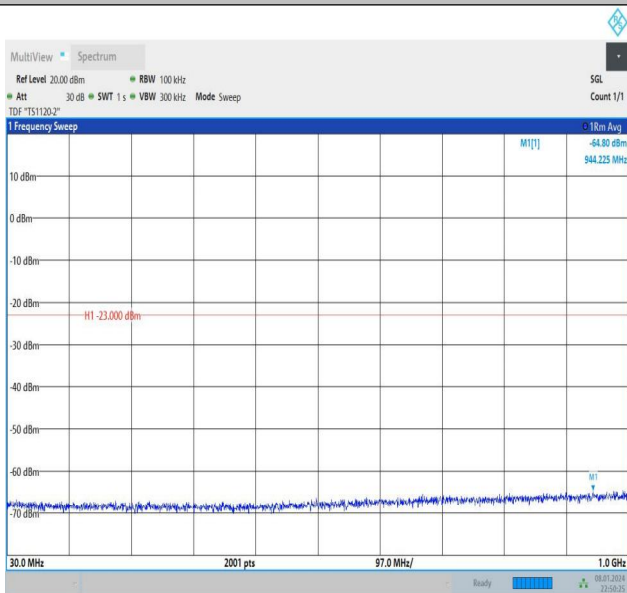


Band2_15MHz_QPSK_18900_75RB#0_30~1000_30~1000

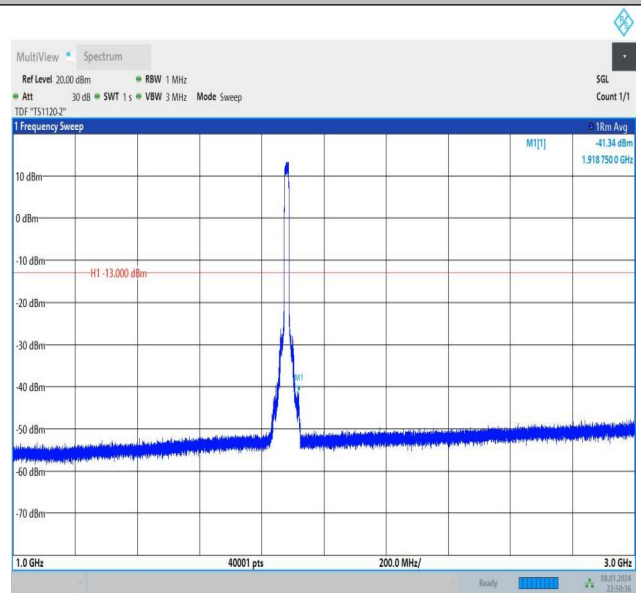


Band2_15MHz_QPSK_18900_75RB#0_1000~3000_1000~30


00

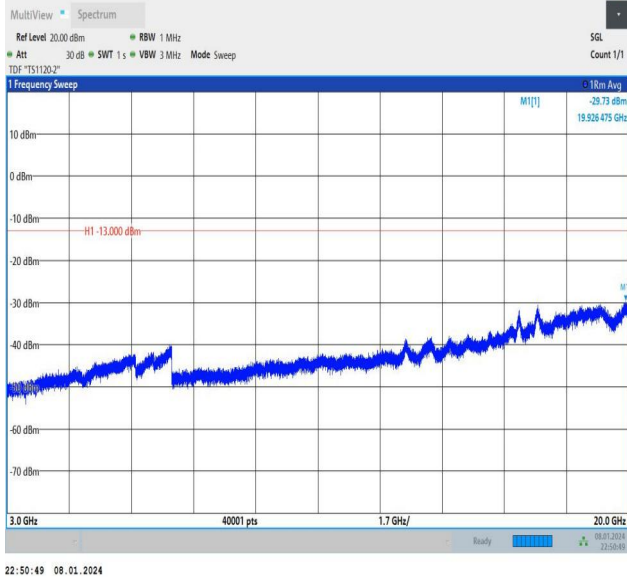


Band2_15MHz_QPSK_18900_75RB#0_3000~20000_3000~20000

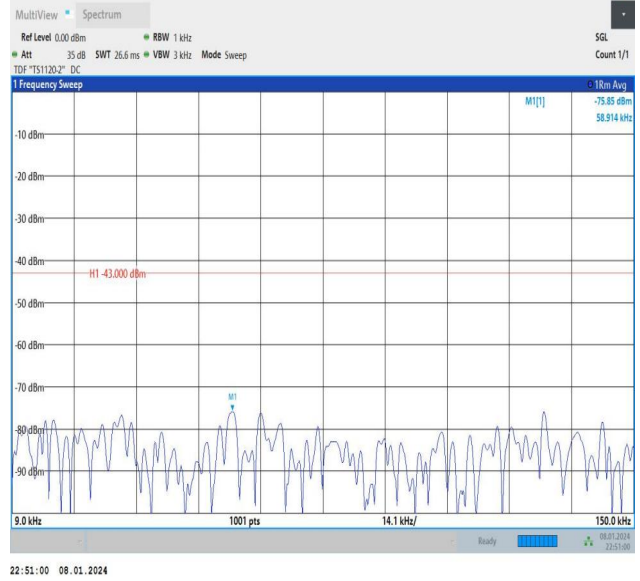


Band2_15MHz_QPSK_19125_75RB#0_0.009~0.15_0.009~0.15

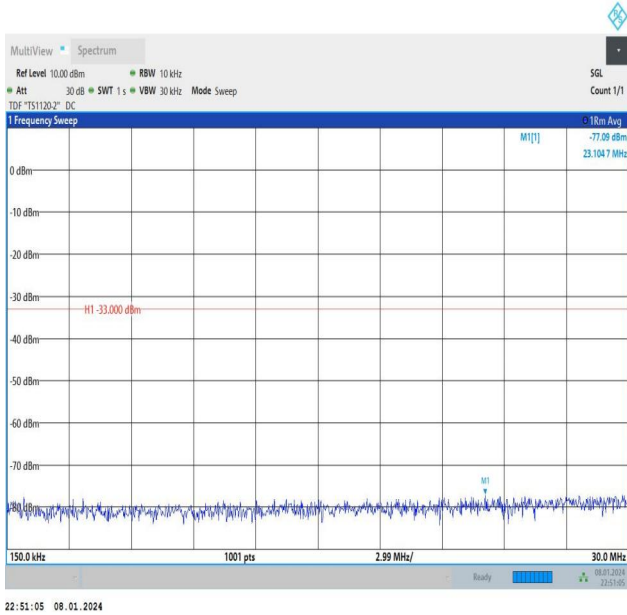


Band2_15MHz_QPSK_19125_75RB#0_0.15~30_0.15~30

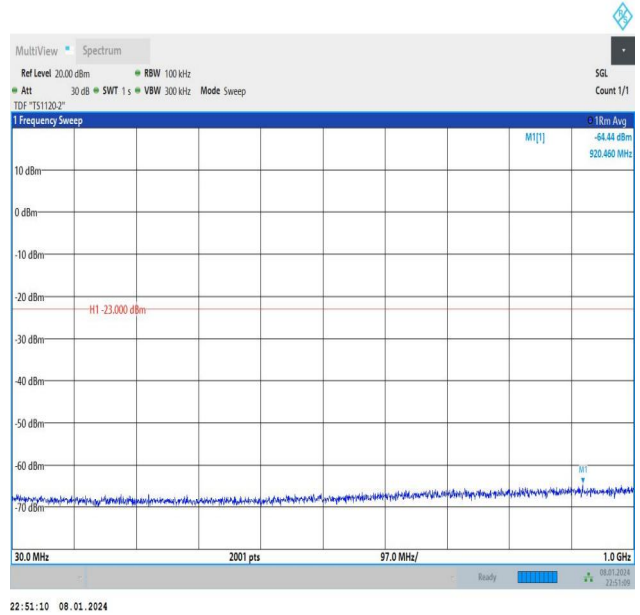


Band2_15MHz_QPSK_19125_75RB#0_30~1000_30~1000

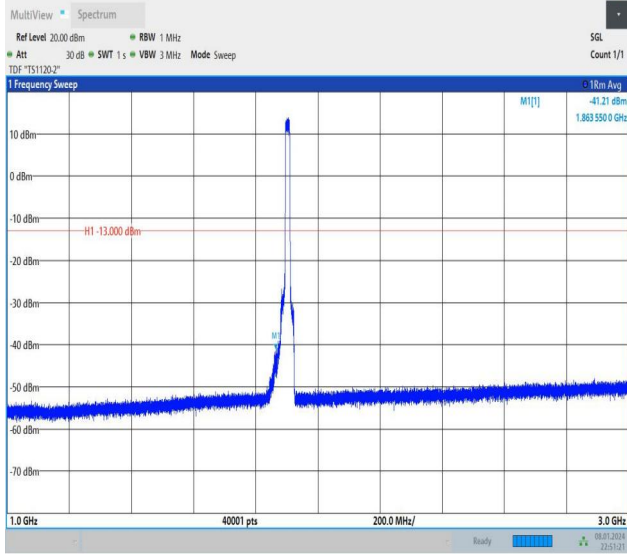


Band2_15MHz_QPSK_19125_75RB#0_1000~3000_1000~30
00

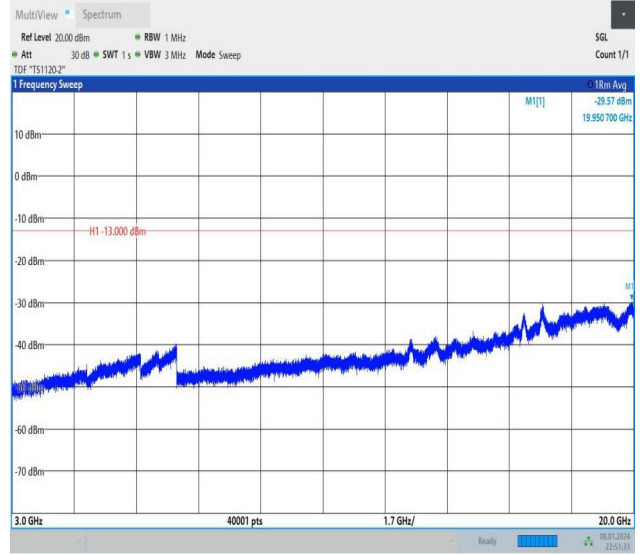


Band2_15MHz_QPSK_19125_75RB#0_3000~20000_3000~2
0000

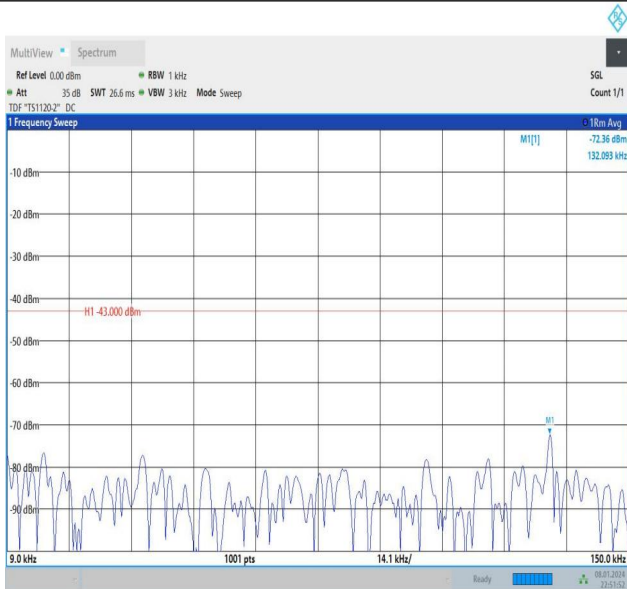


Band2_20MHz_QPSK_18700_1RB#0_0.009~0.15_0.009~0.1
5

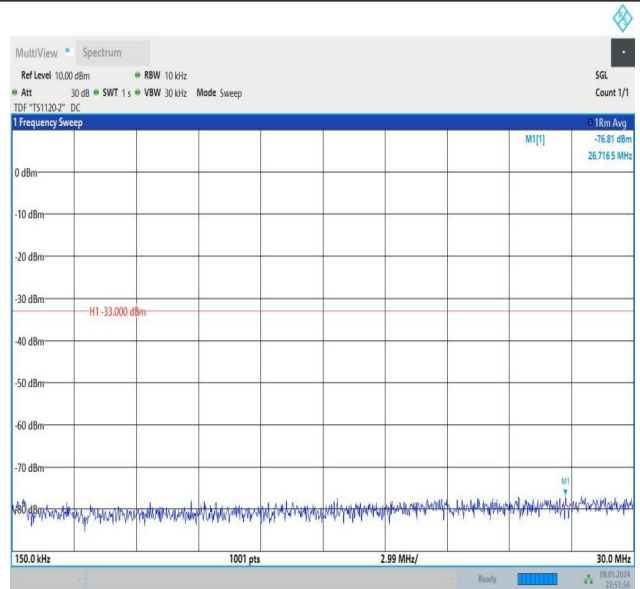


Band2_20MHz_QPSK_18700_1RB#0_0.15~30_0.15~30

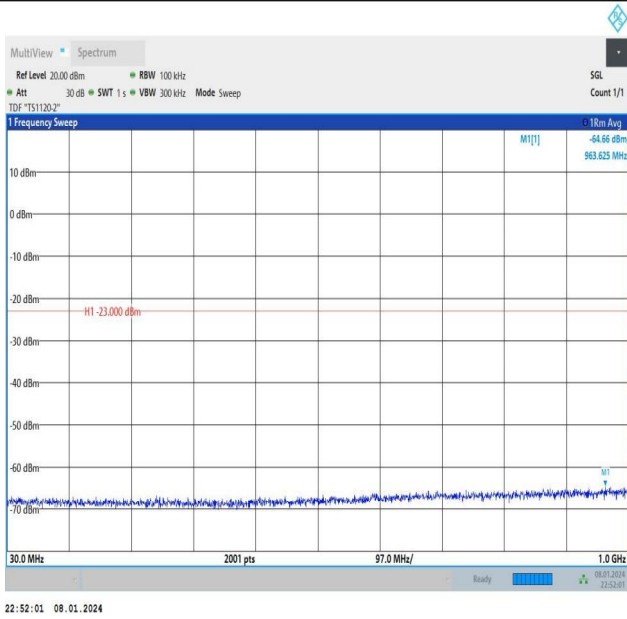


Band2_20MHz_QPSK_18700_1RB#0_30~1000_30~1000

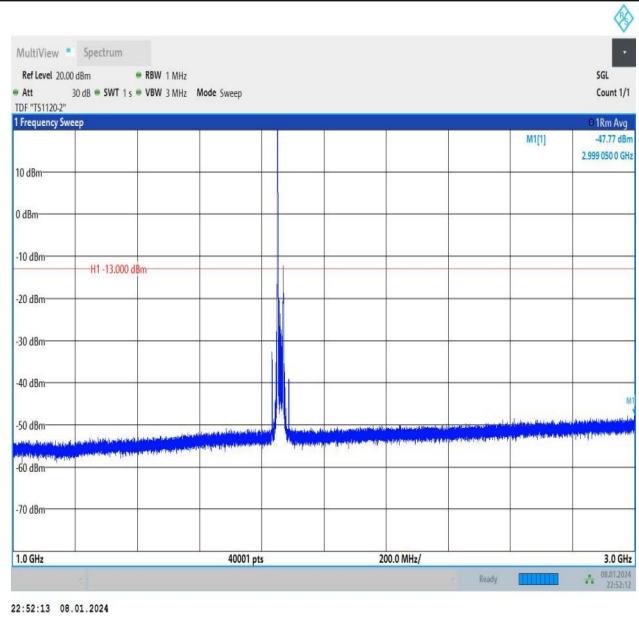


Band2_20MHz_QPSK_18700_1RB#0_1000~3000_1000~300
0

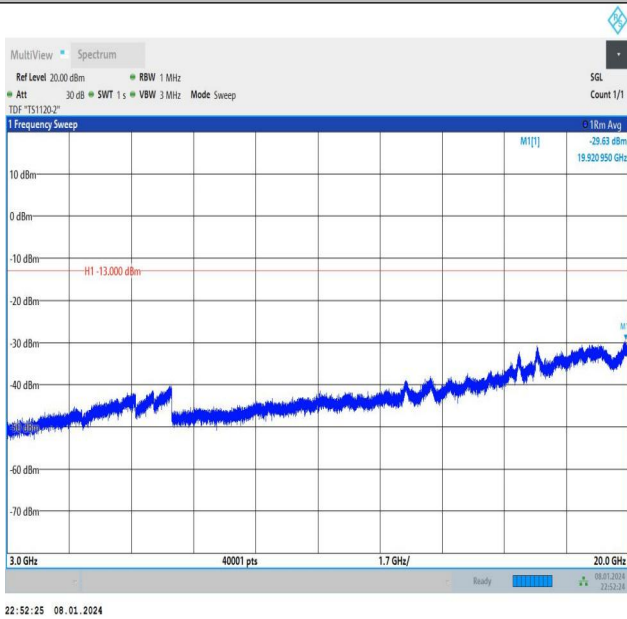


Band2_20MHz_QPSK_18700_1RB#0_3000~20000_3000~20
000

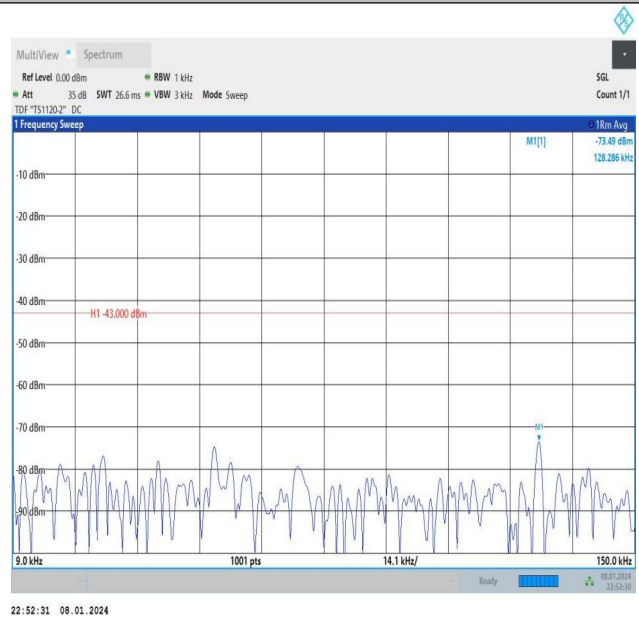


Band2_20MHz_16QAM_18700_1RB#0_0.009~0.15_0.009~0.
15

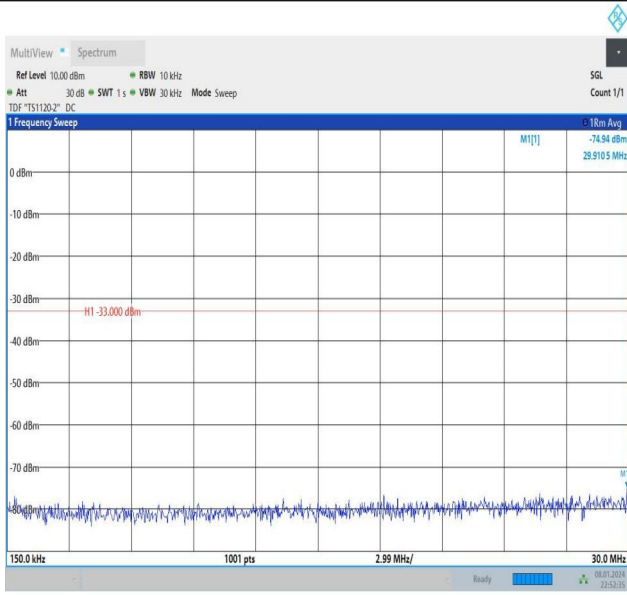


Band2_20MHz_16QAM_18700_1RB#0_0.15~30_0.15~30

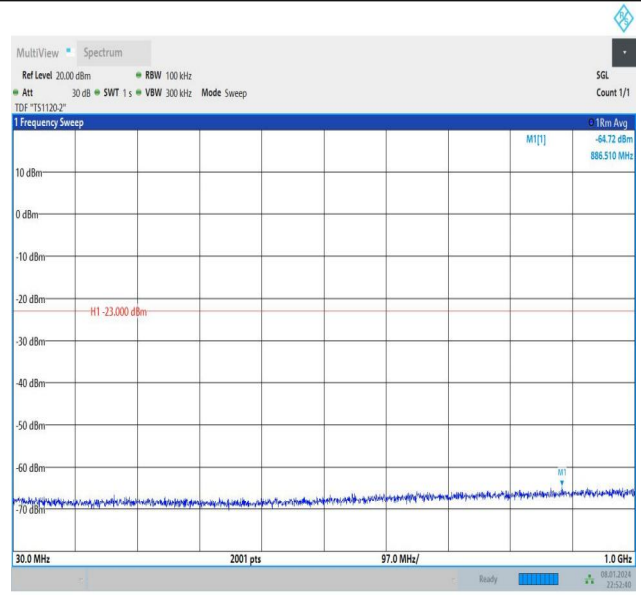


Band2_20MHz_16QAM_18700_1RB#0_30~1000_30~1000

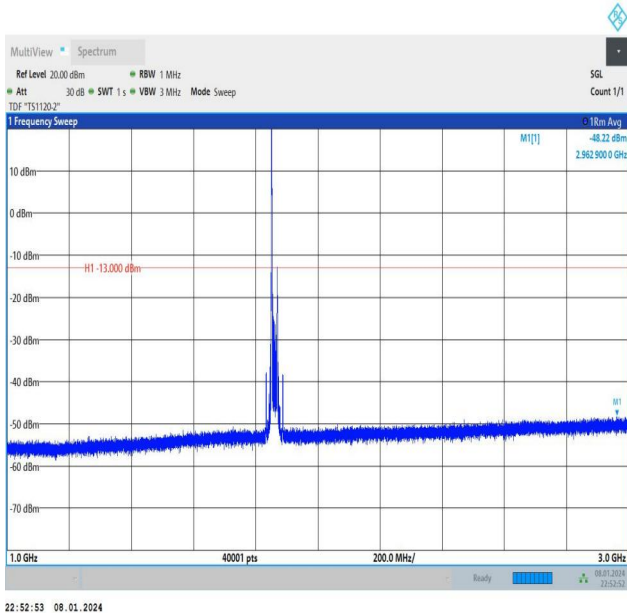

Band2_20MHz_16QAM_18700_1RB#0_1000~3000_1000~3000

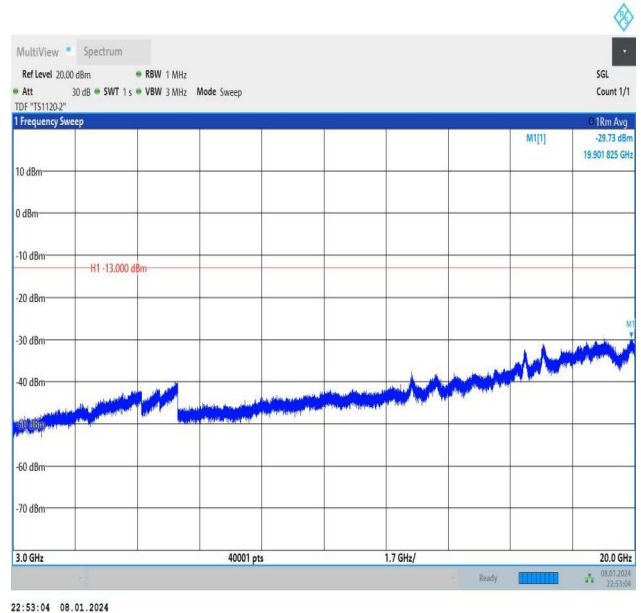


Band2_20MHz_16QAM_18700_1RB#0_3000~20000_3000~20000

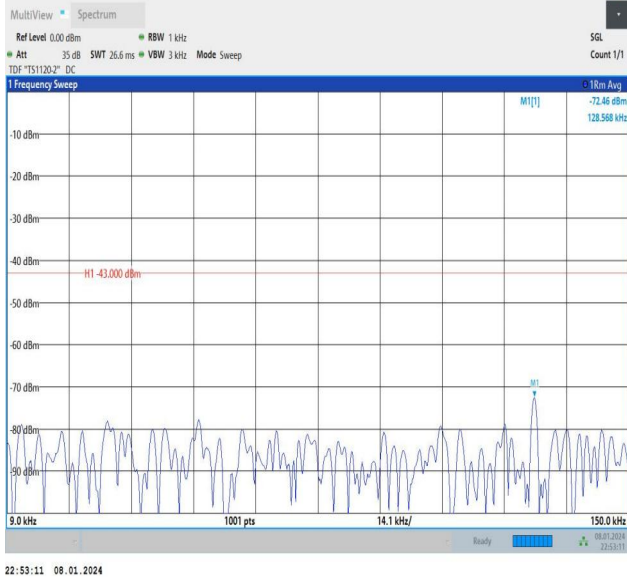


Band2_20MHz_QPSK_18700_1RB#99_0.009~0.15_0.009~0.


15

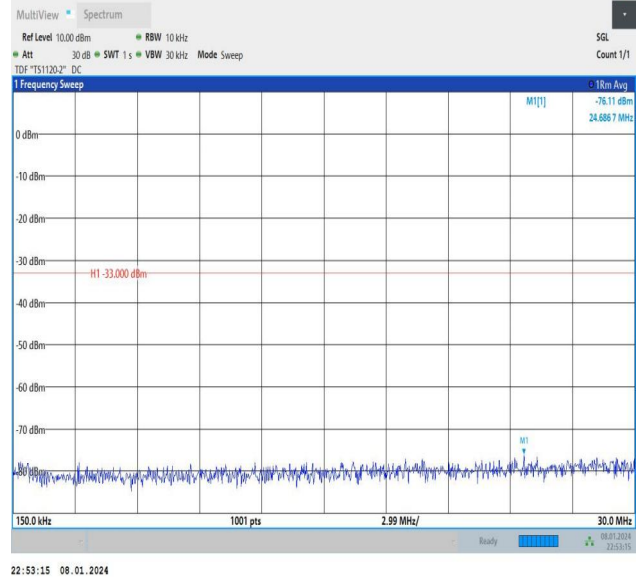

Band2_20MHz_QPSK_18700_1RB#99_0.15~30_0.15~30

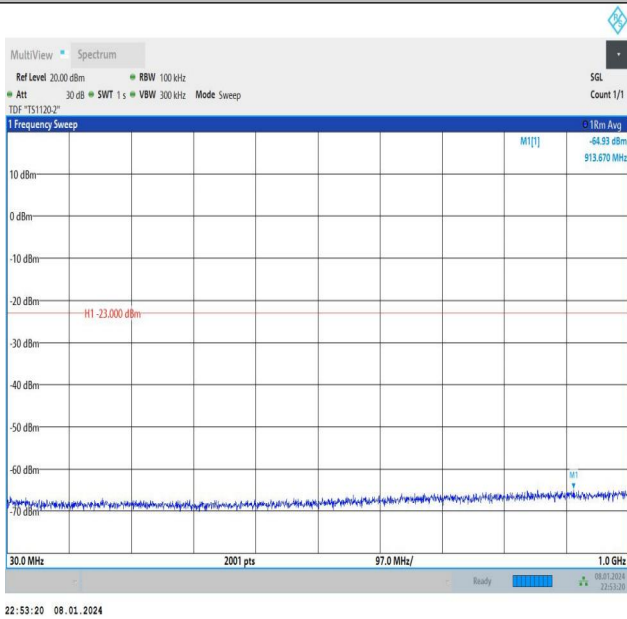


Band2_20MHz_QPSK_18700_1RB#99_30~1000_30~1000

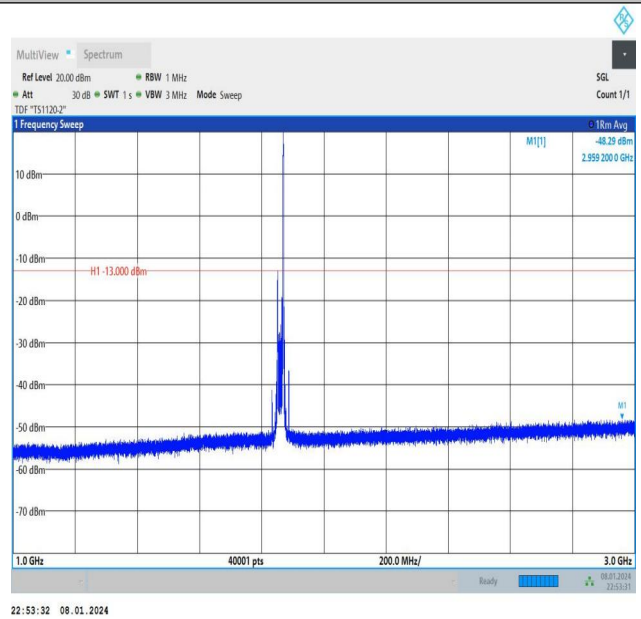


Band2_20MHz_QPSK_18700_1RB#99_1000~3000_1000~30


00

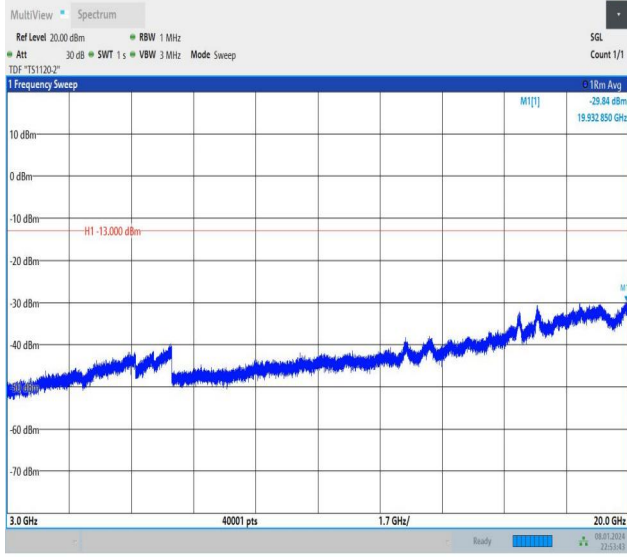


Band2_20MHz_QPSK_18700_1RB#99_3000~20000_3000~20000

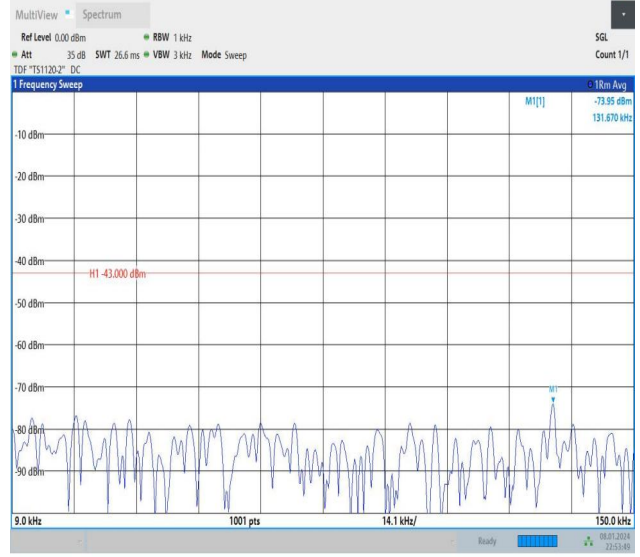


Band2_20MHz_16QAM_18700_1RB#99_0.009~0.15_0.009~0.15

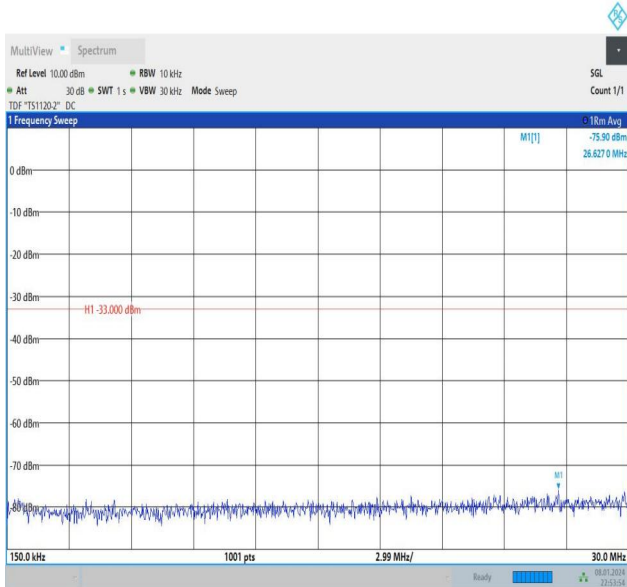


Band2_20MHz_16QAM_18700_1RB#99_0.15~30_0.15~30

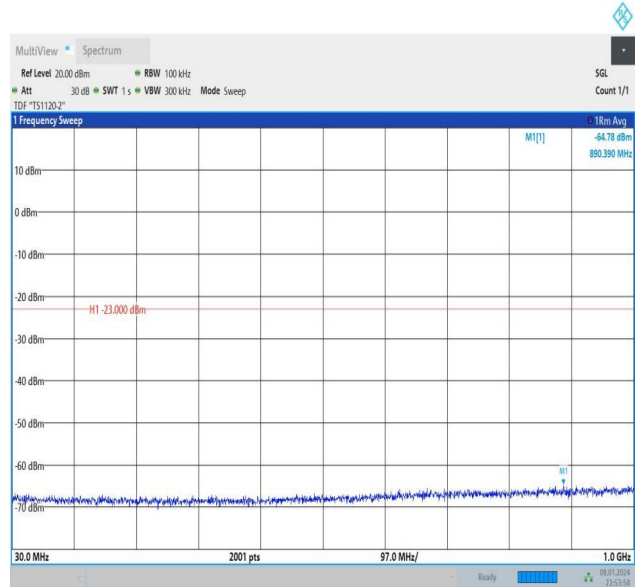


Band2_20MHz_16QAM_18700_1RB#99_30~1000_30~1000

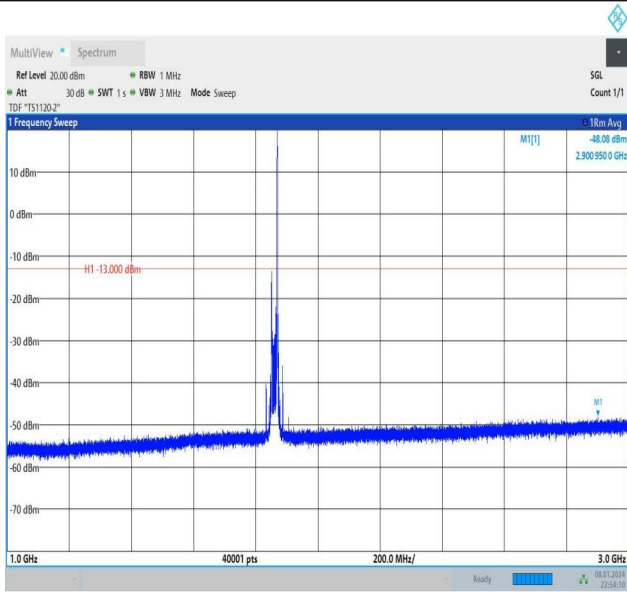


Band2_20MHz_16QAM_18700_1RB#99_1000~3000_1000~3000

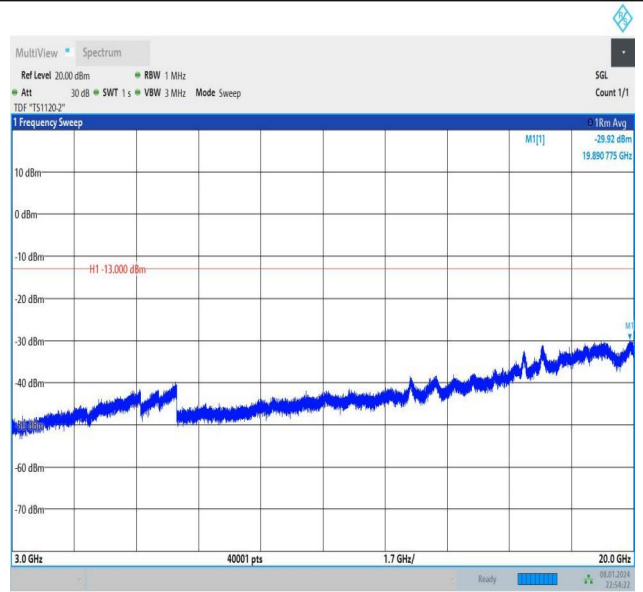


Band2_20MHz_16QAM_18700_1RB#99_3000~20000_3000~20000

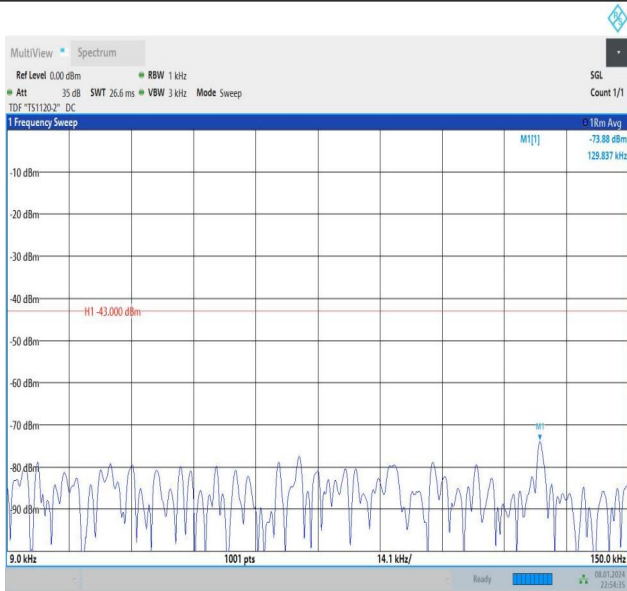

Band2_20MHz_QPSK_18900_1RB#0_0.009~0.15_0.009~0.15

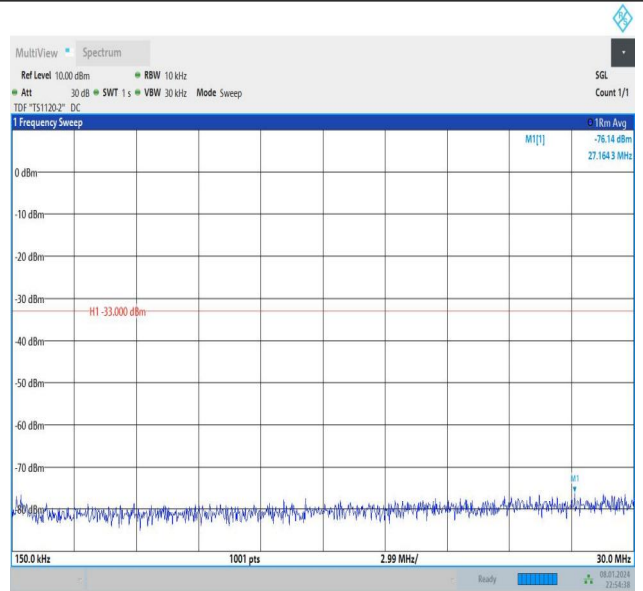


Band2_20MHz_QPSK_18900_1RB#0_0.15~30_0.15~30

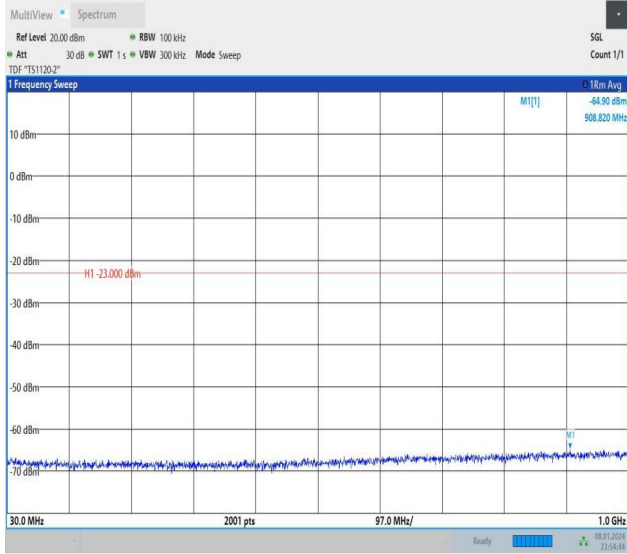

22:54:44 08.01.2024


Band2_20MHz_QPSK_18900_1RB#0_30~1000_30~1000

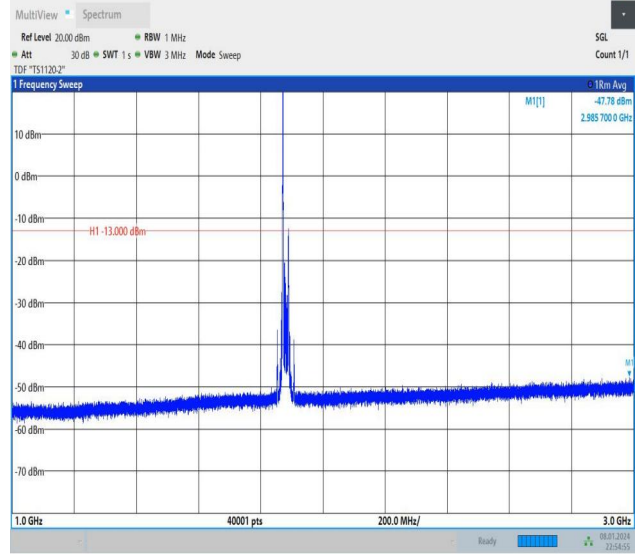

22:54:56 08.01.2024


Band2_20MHz_QPSK_18900_1RB#0_1000~3000_1000~300

0

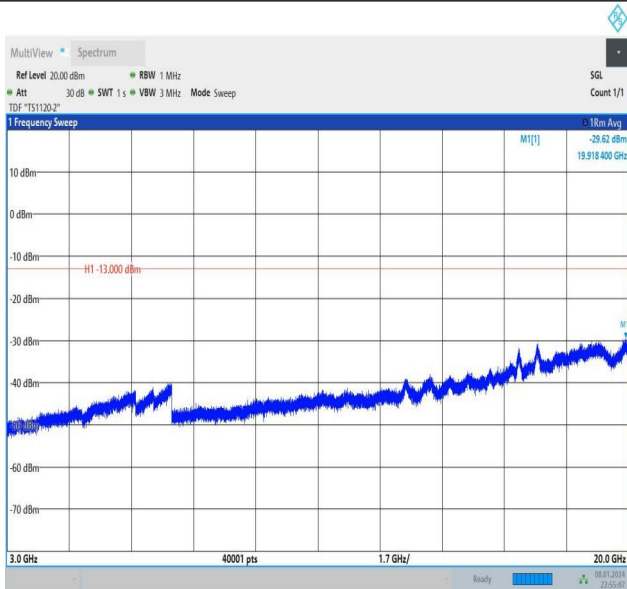

22:55:08 08.01.2024


Band2_20MHz_QPSK_18900_1RB#0_3000~20000_3000~20000

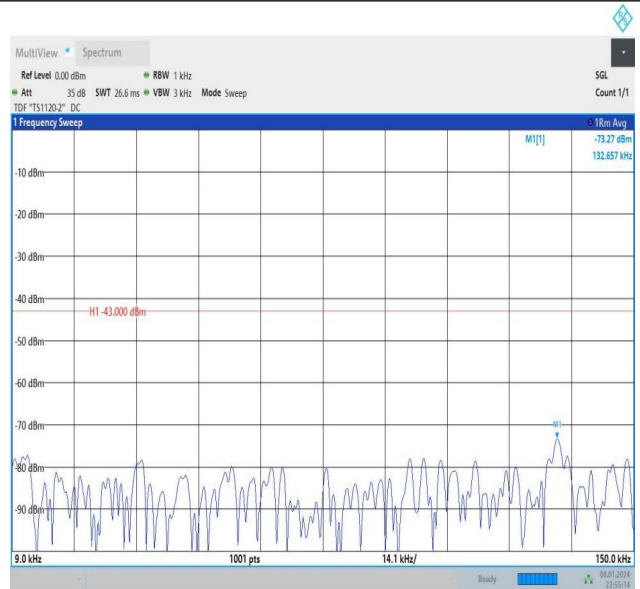


22:55:14 08.01.2024

Band2_20MHz_16QAM_18900_1RB#0_0.009~0.15_0.009~0.15


15

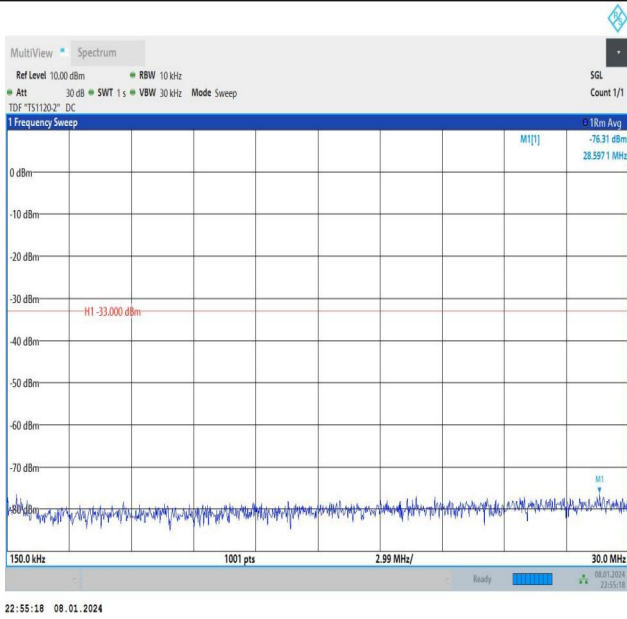


Band2_20MHz_16QAM_18900_1RB#0_0.15~30_0.15~30

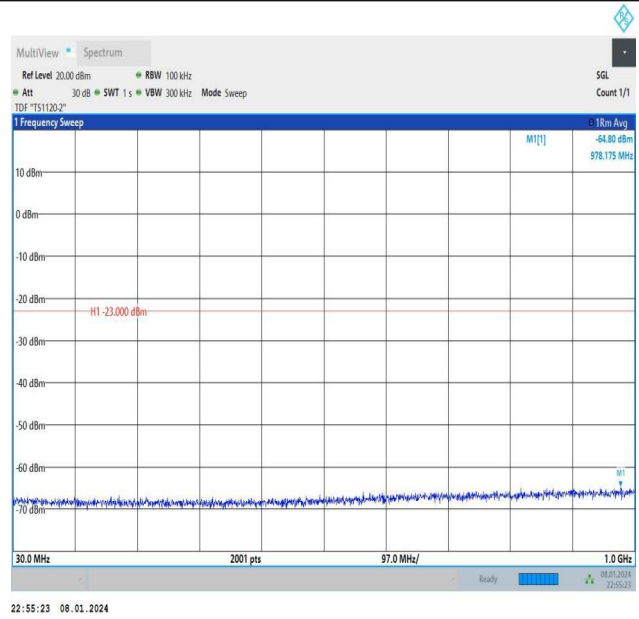


Band2_20MHz_16QAM_18900_1RB#0_30~1000_30~1000

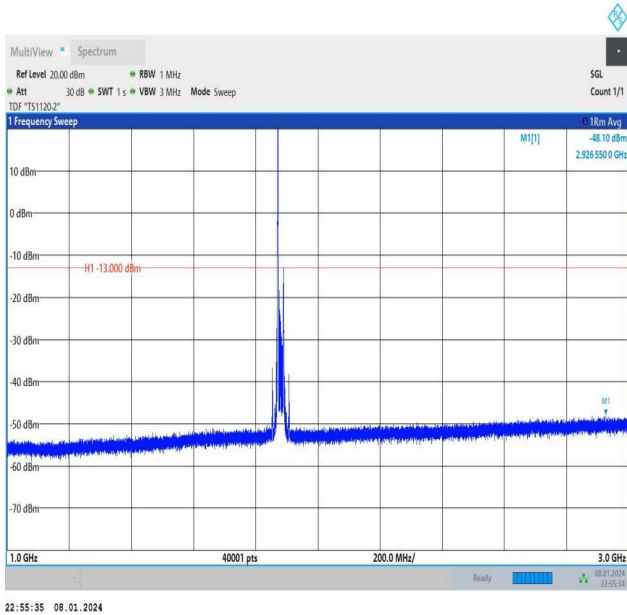

Band2_20MHz_16QAM_18900_1RB#0_1000~3000_1000~3000

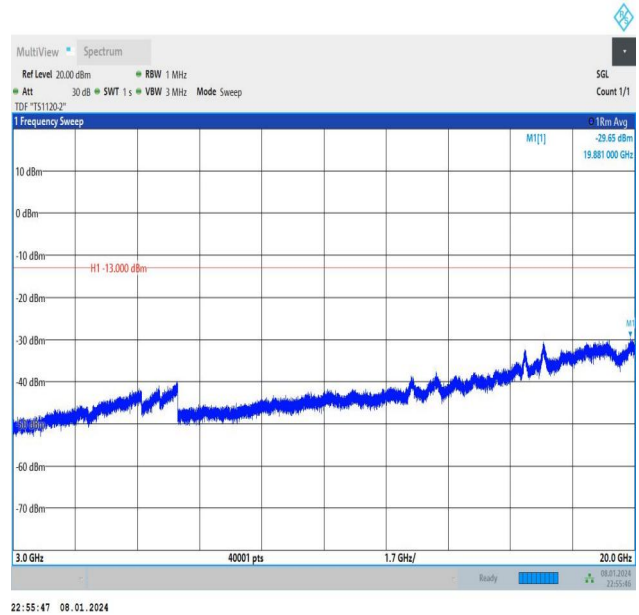


Band2_20MHz_16QAM_18900_1RB#0_3000~20000_3000~20000

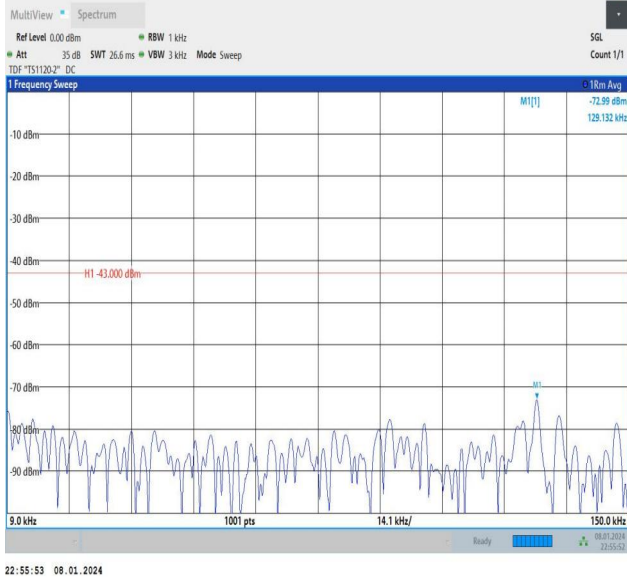


Band2_20MHz_QPSK_18900_1RB#99_0.009~0.15_0.009~0.


15

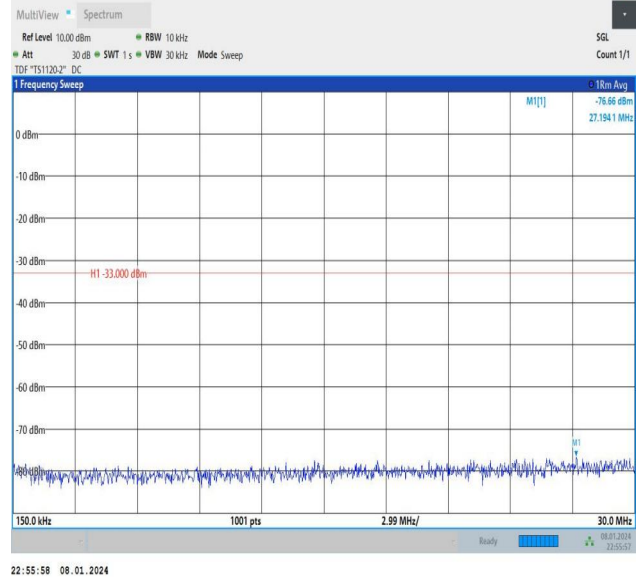

Band2_20MHz_QPSK_18900_1RB#99_0.15~30_0.15~30

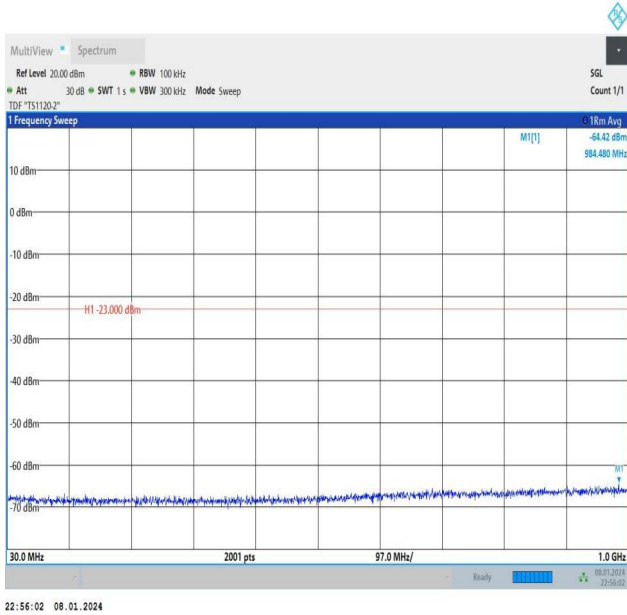


Band2_20MHz_QPSK_18900_1RB#99_30~1000_30~1000

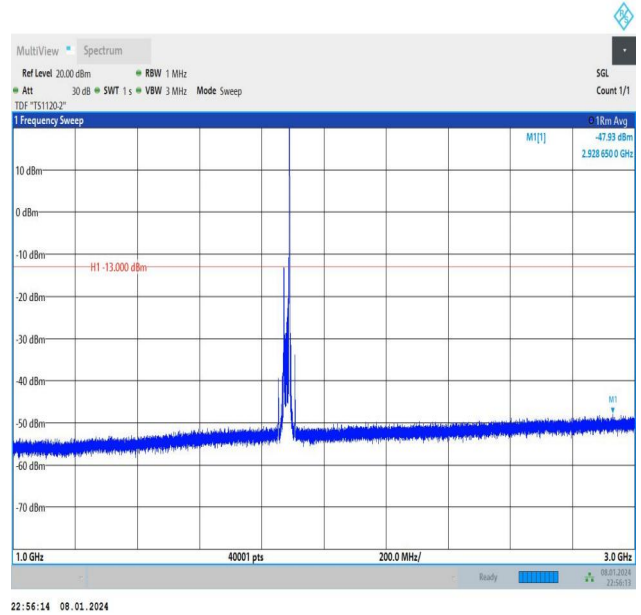


Band2_20MHz_QPSK_18900_1RB#99_1000~3000_1000~30


00

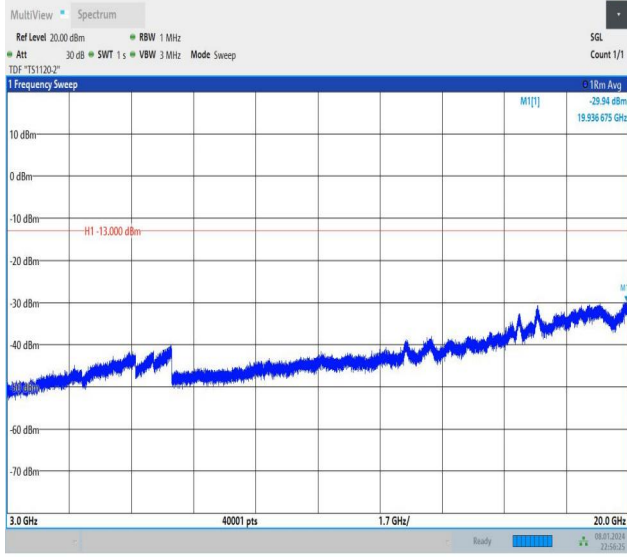


Band2_20MHz_QPSK_18900_1RB#99_3000~20000_3000~20000

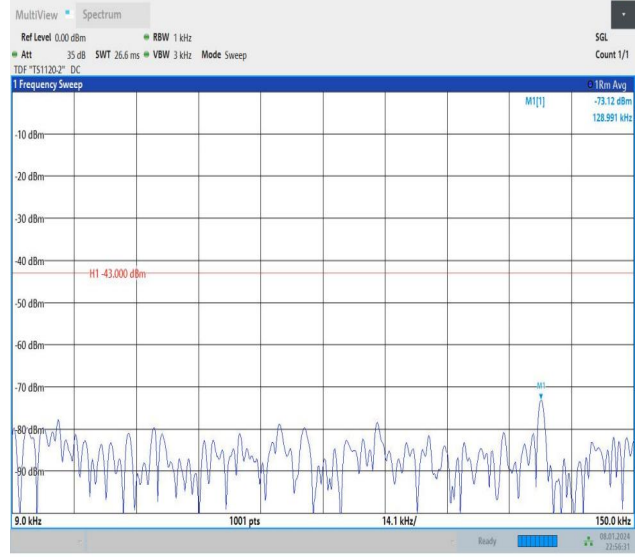


Band2_20MHz_16QAM_18900_1RB#99_0.009~0.15_0.009~0.15

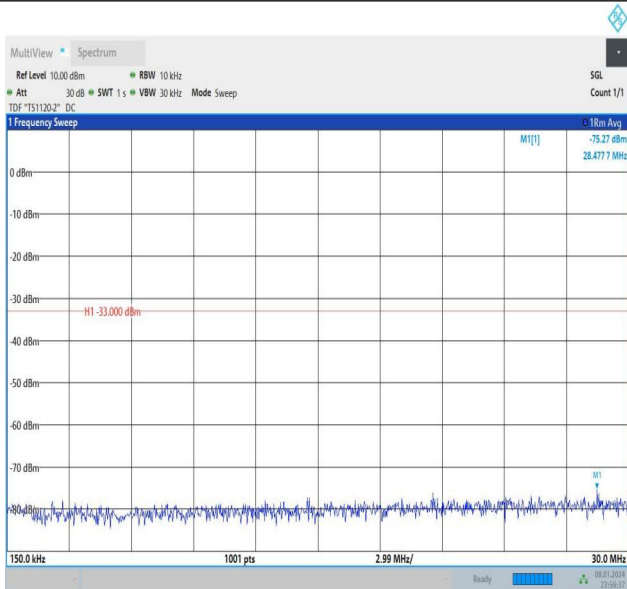


Band2_20MHz_16QAM_18900_1RB#99_0.15~30_0.15~30

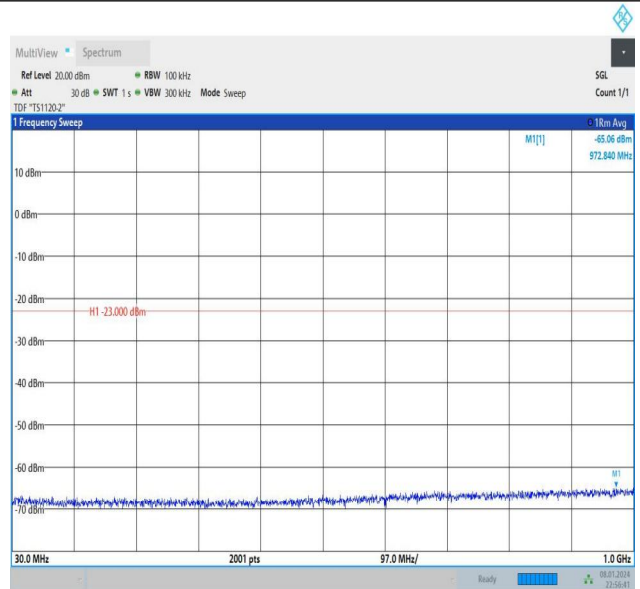


Band2_20MHz_16QAM_18900_1RB#99_30~1000_30~1000

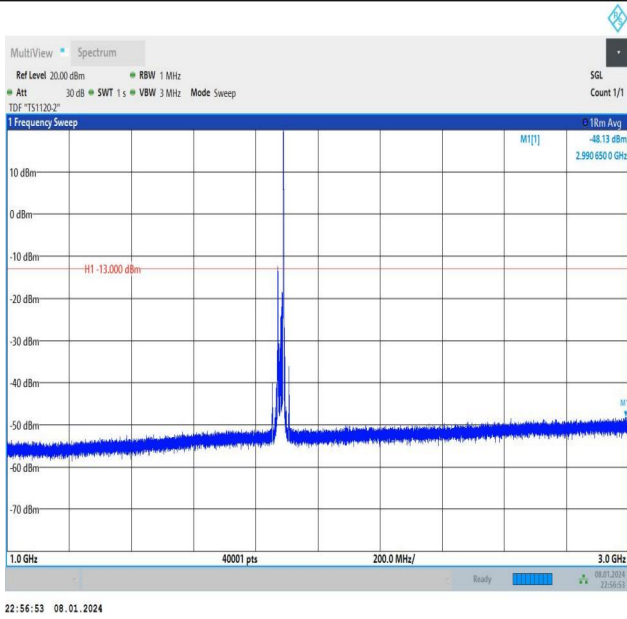


Band2_20MHz_16QAM_18900_1RB#99_1000~3000_1000~3000

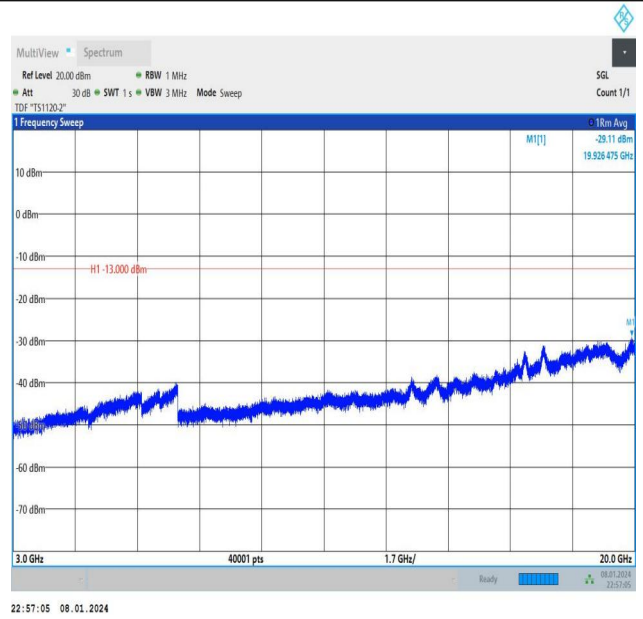


Band2_20MHz_16QAM_18900_1RB#99_3000~20000_3000~20000

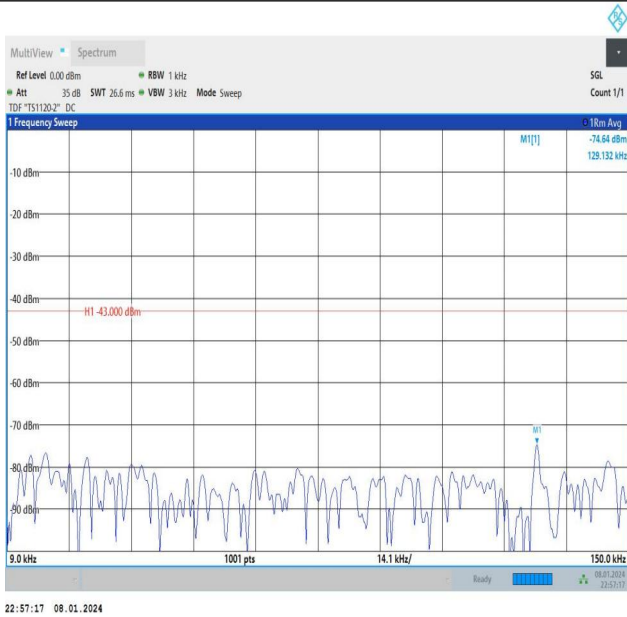

Band2_20MHz_QPSK_19100_1RB#0_0.009~0.15_0.009~0.15

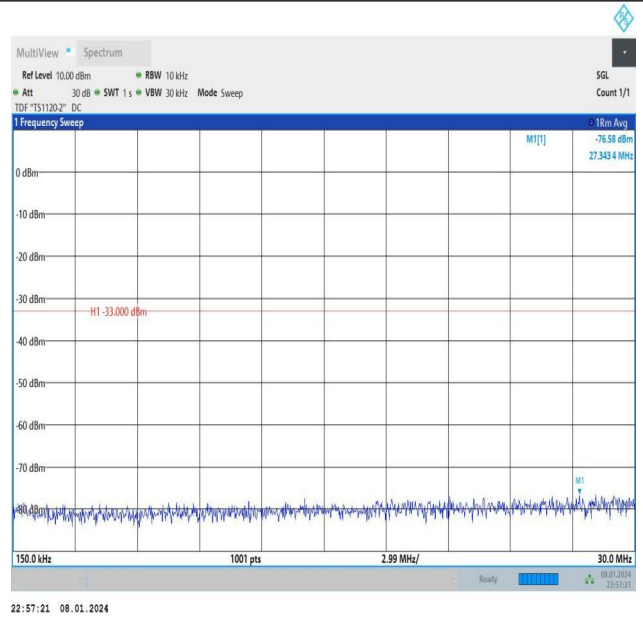


Band2_20MHz_QPSK_19100_1RB#0_0.15~30_0.15~30

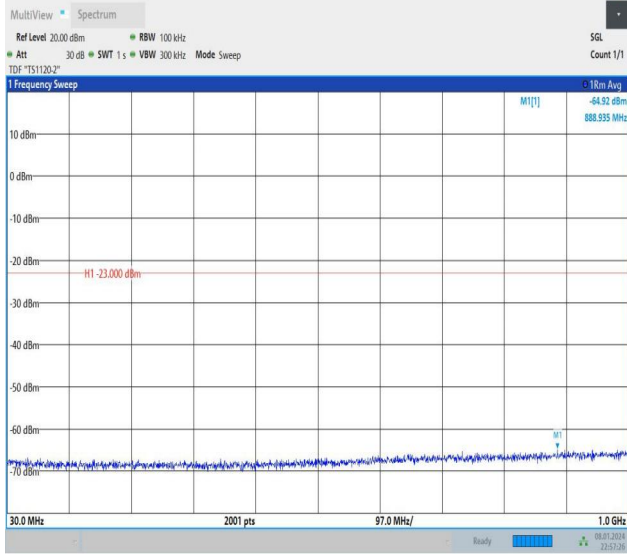

22:57:26 08.01.2024


Band2_20MHz_QPSK_19100_1RB#0_30~1000_30~1000

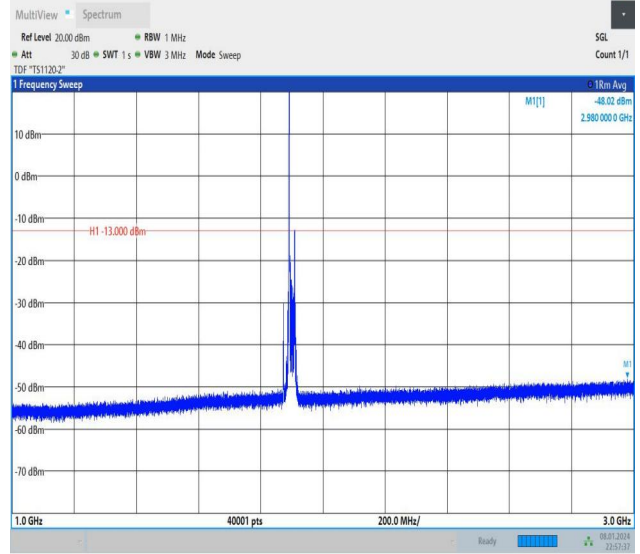

22:57:38 08.01.2024


Band2_20MHz_QPSK_19100_1RB#0_1000~3000_1000~300

0

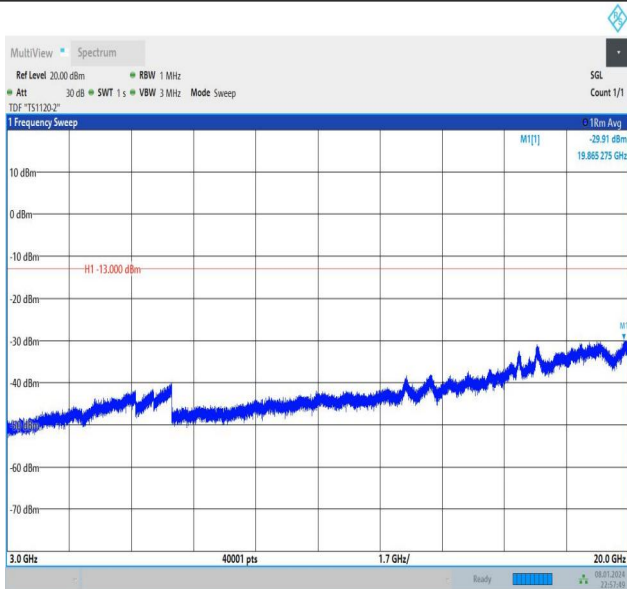

22:57:50 08.01.2024


Band2_20MHz_QPSK_19100_1RB#0_3000~20000_3000~20000

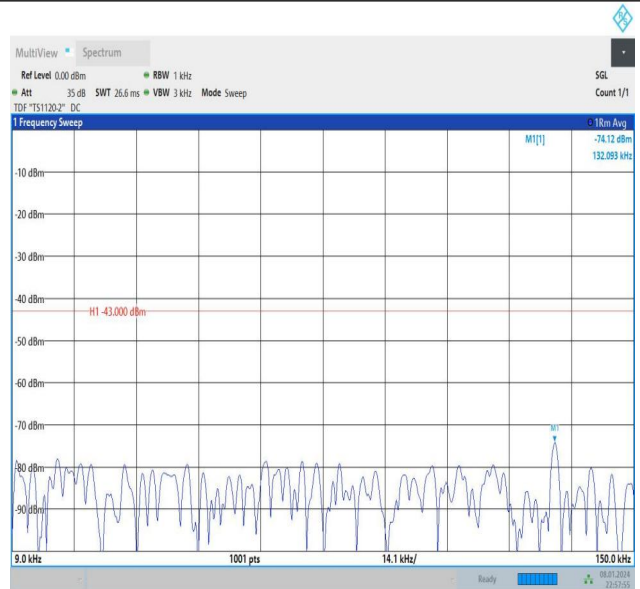


22:57:56 08.01.2024

Band2_20MHz_16QAM_19100_1RB#0_0.009~0.15_0.009~0.15


15

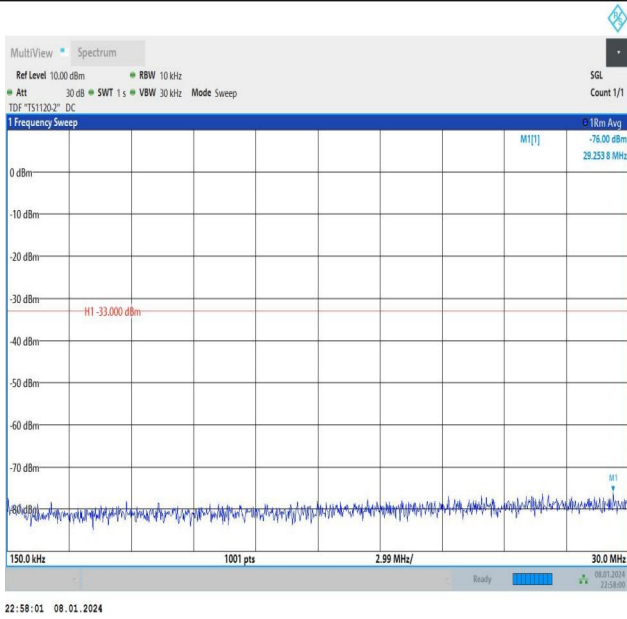


Band2_20MHz_16QAM_19100_1RB#0_0.15~30_0.15~30

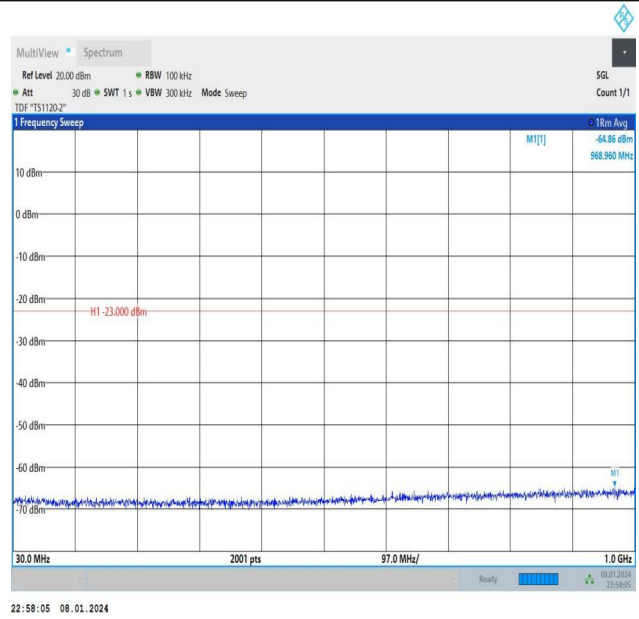


Band2_20MHz_16QAM_19100_1RB#0_30~1000_30~1000

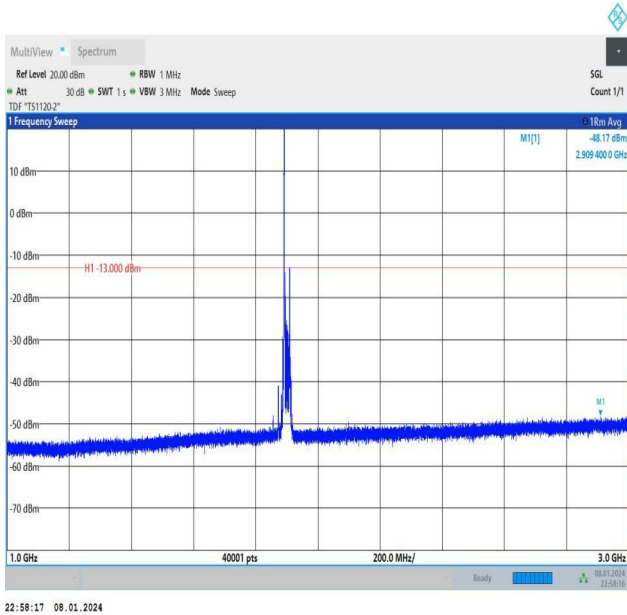

Band2_20MHz_16QAM_19100_1RB#0_1000~3000_1000~3000

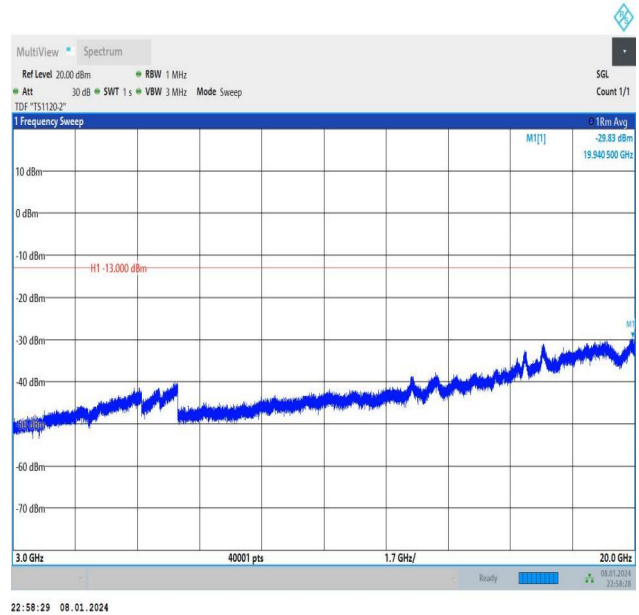


Band2_20MHz_16QAM_19100_1RB#0_3000~20000_3000~20000

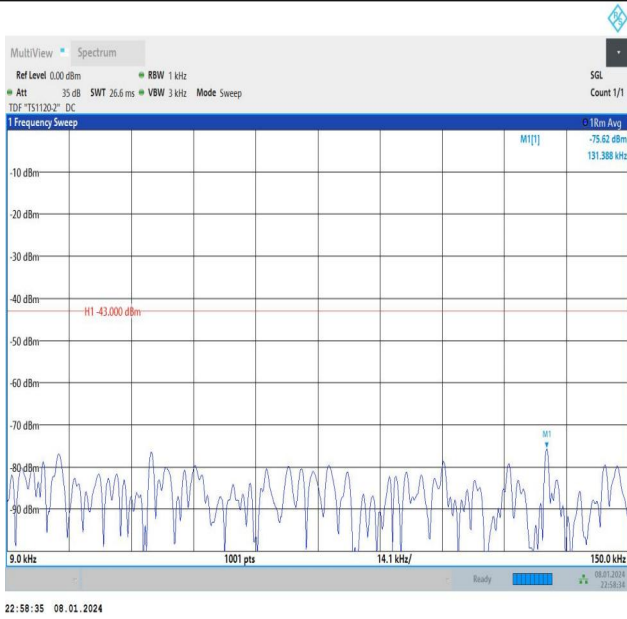


Band2_20MHz_QPSK_19100_1RB#99_0.009~0.15_0.009~0.


15

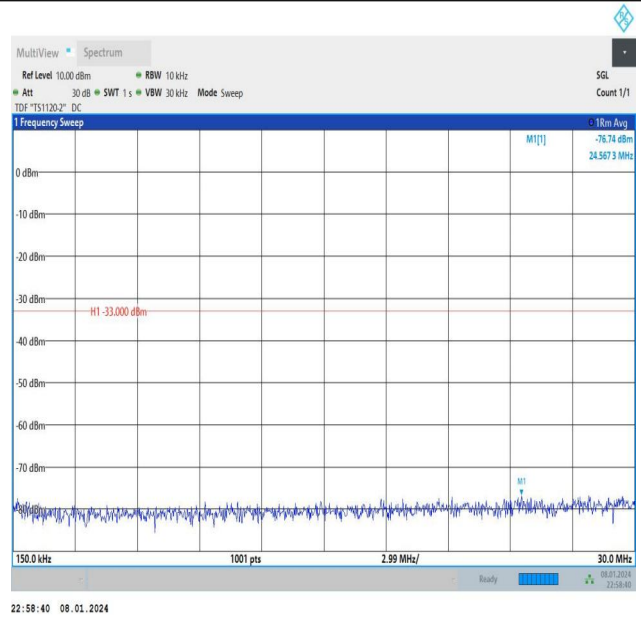

Band2_20MHz_QPSK_19100_1RB#99_0.15~30_0.15~30

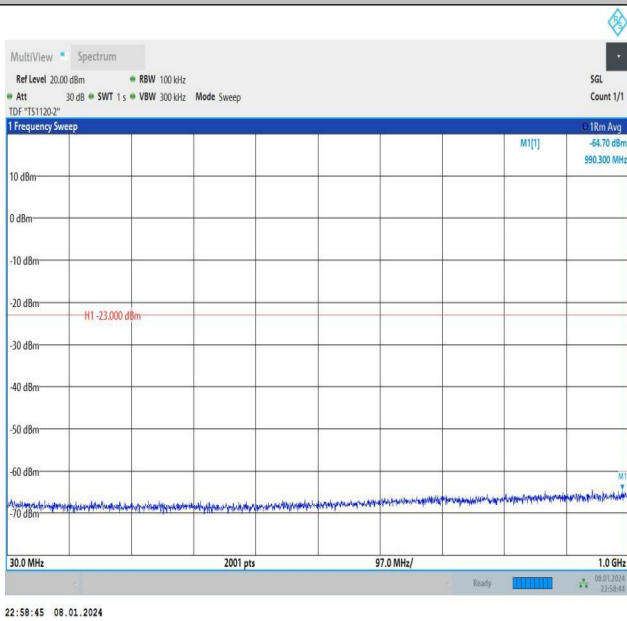


Band2_20MHz_QPSK_19100_1RB#99_30~1000_30~1000

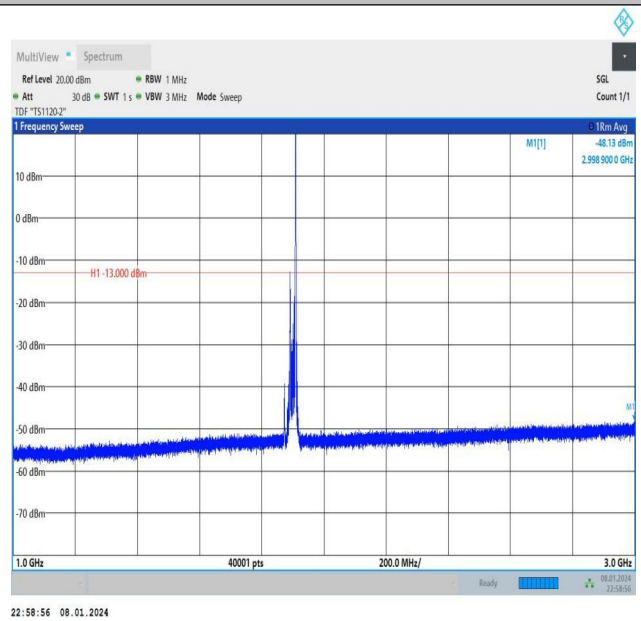


Band2_20MHz_QPSK_19100_1RB#99_1000~3000_1000~30


00

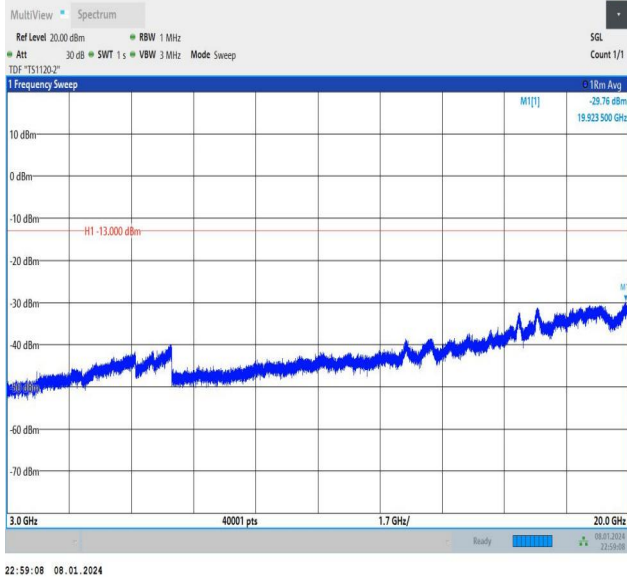


Band2_20MHz_QPSK_19100_1RB#99_3000~20000_3000~20000

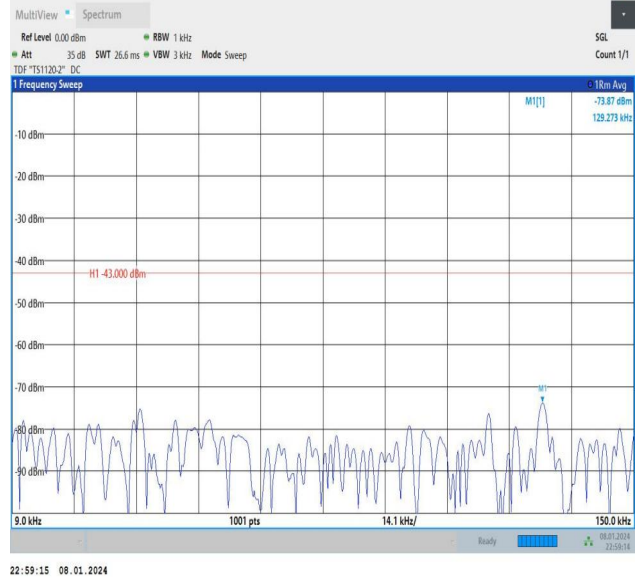


Band2_20MHz_16QAM_19100_1RB#99_0.009~0.15_0.009~0.15

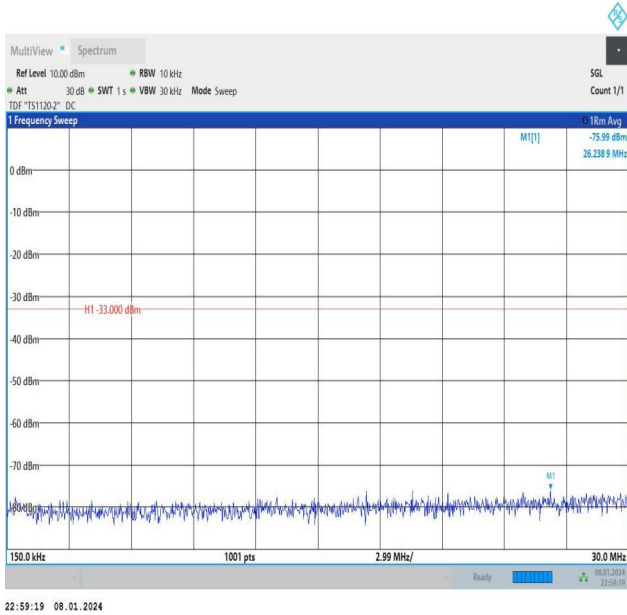


Band2_20MHz_16QAM_19100_1RB#99_0.15~30_0.15~30

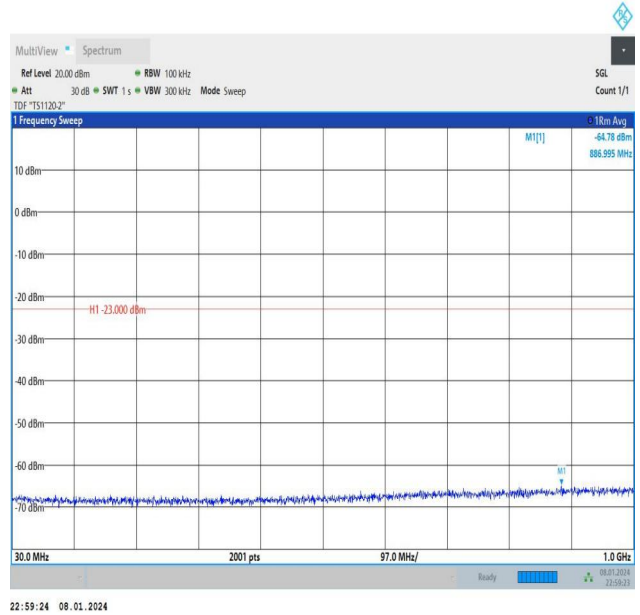


Band2_20MHz_16QAM_19100_1RB#99_30~1000_30~1000

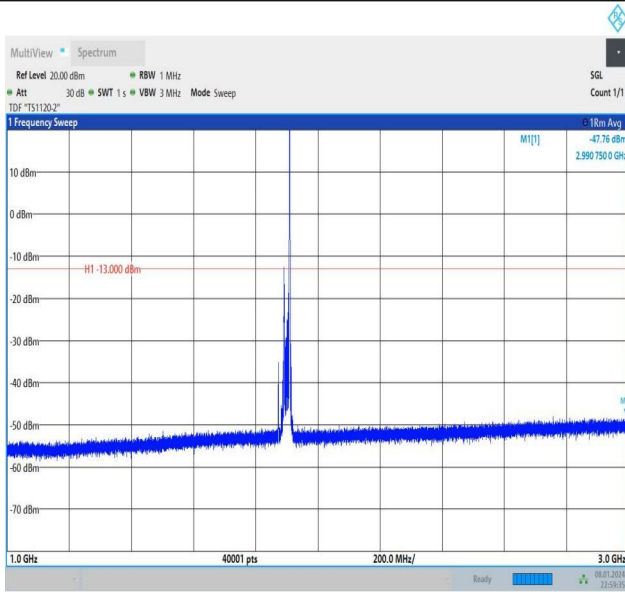


Band2_20MHz_16QAM_19100_1RB#99_1000~3000_1000~3000

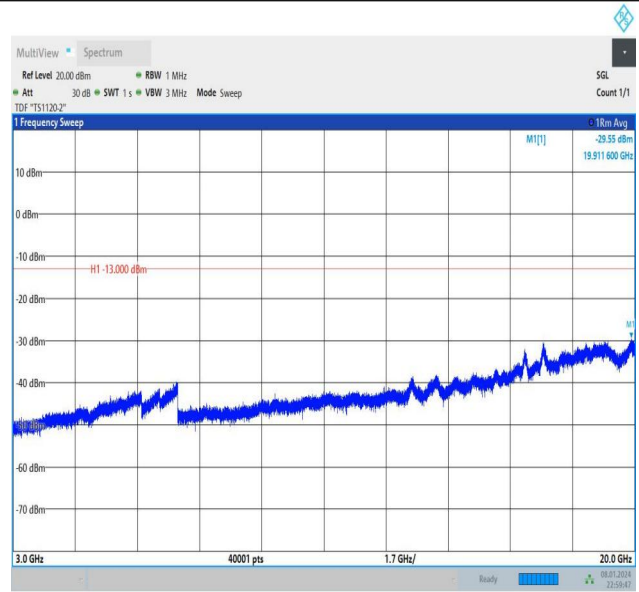


Band2_20MHz_16QAM_19100_1RB#99_3000~20000_3000~20000

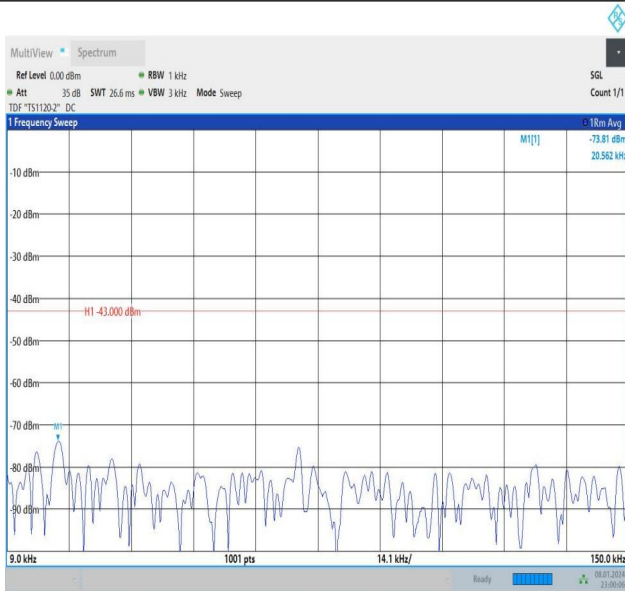


Band2_20MHz_QPSK_18700_100RB#0_0.009~0.15_0.009~0.15

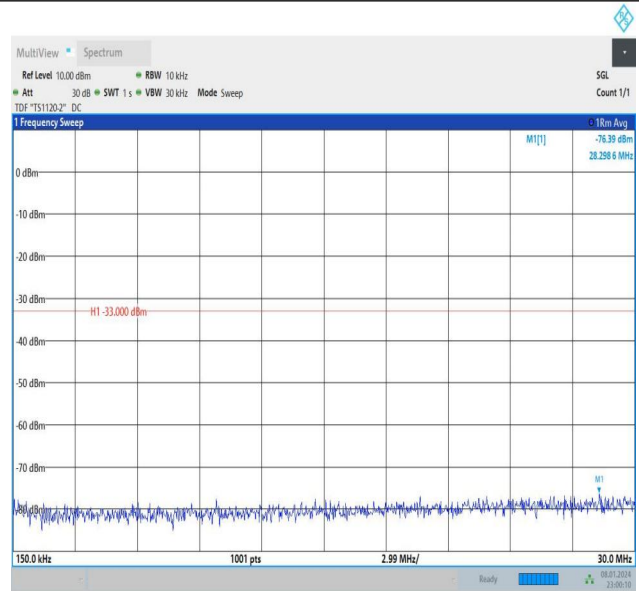


Band2_20MHz_QPSK_18700_100RB#0_0.15~30_0.15~30

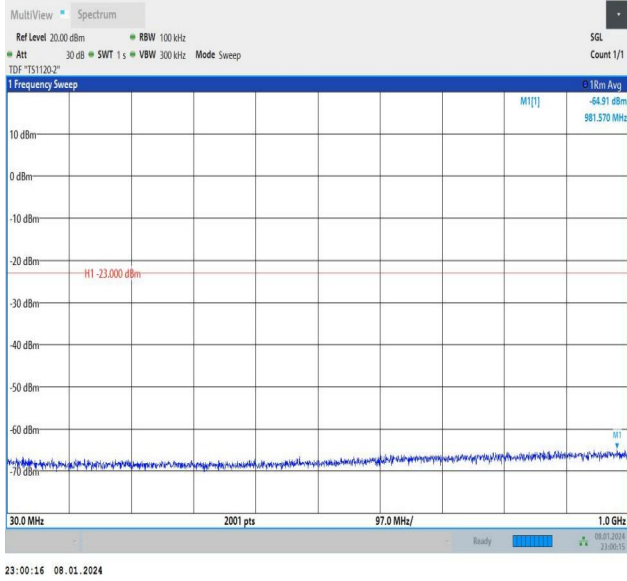


Band2_20MHz_QPSK_18700_100RB#0_30~1000_30~1000

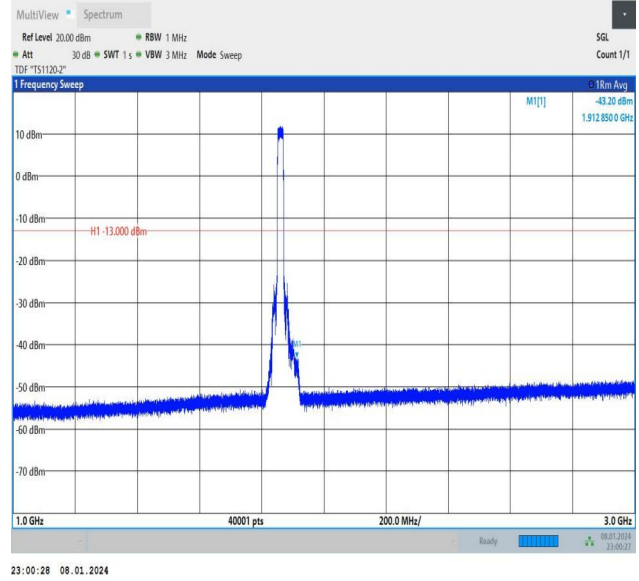


Band2_20MHz_QPSK_18700_100RB#0_1000~3000_1000~3000

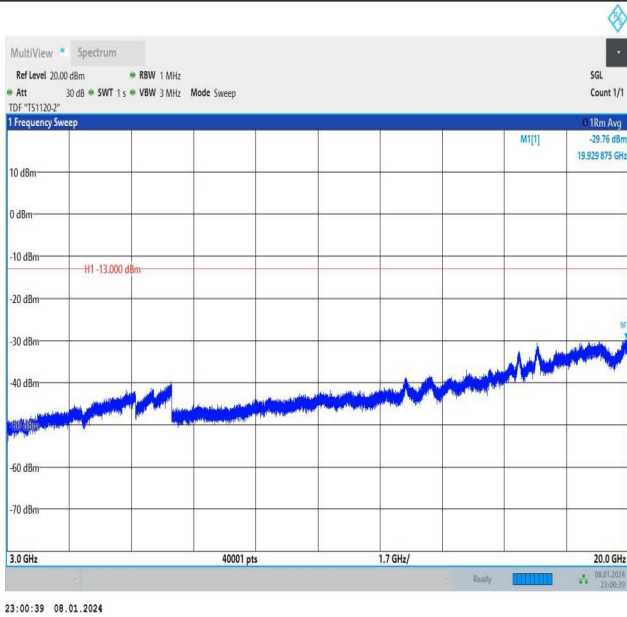


Band2_20MHz_QPSK_18700_100RB#0_3000~20000_3000~20000

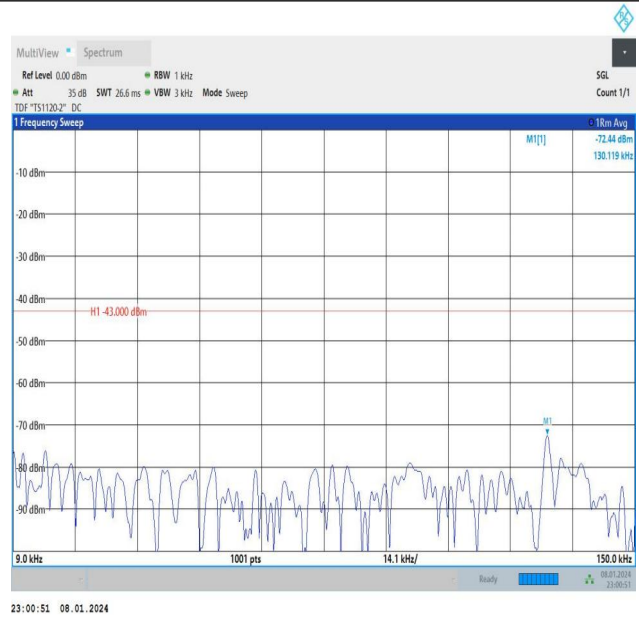


Band2_20MHz_QPSK_18900_100RB#0_0.009~0.15_0.009~0.15

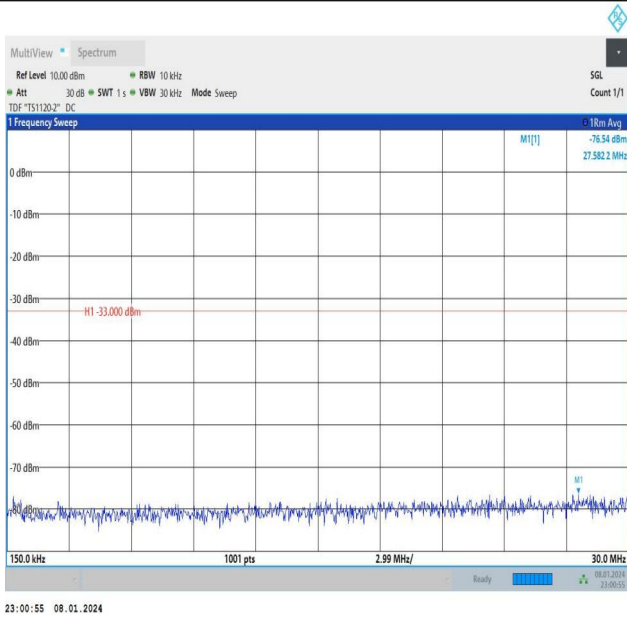


Band2_20MHz_QPSK_18900_100RB#0_0.15~30_0.15~30

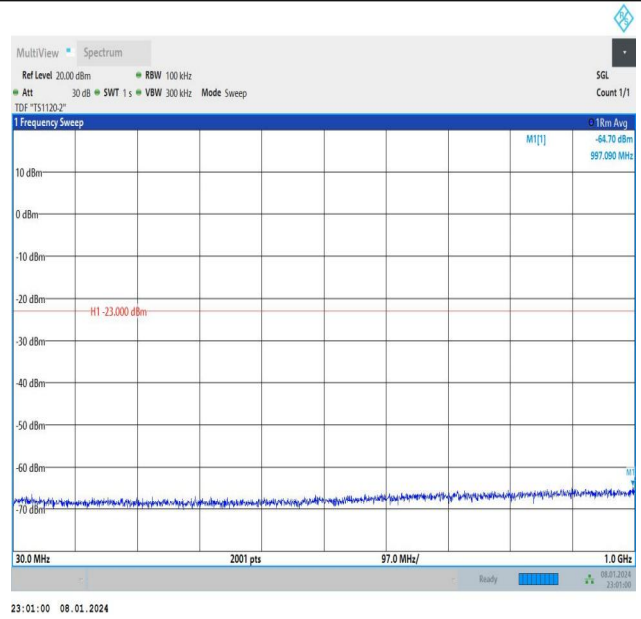


Band2_20MHz_QPSK_18900_100RB#0_30~1000_30~1000

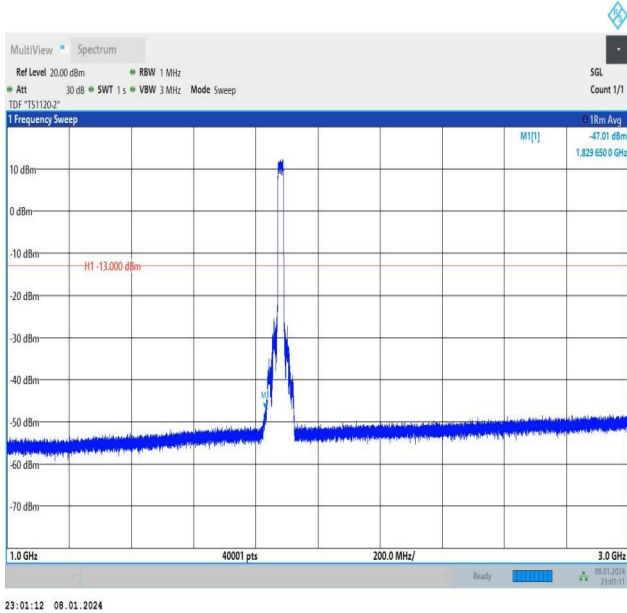


Band2_20MHz_QPSK_18900_100RB#0_1000~3000_1000~3000

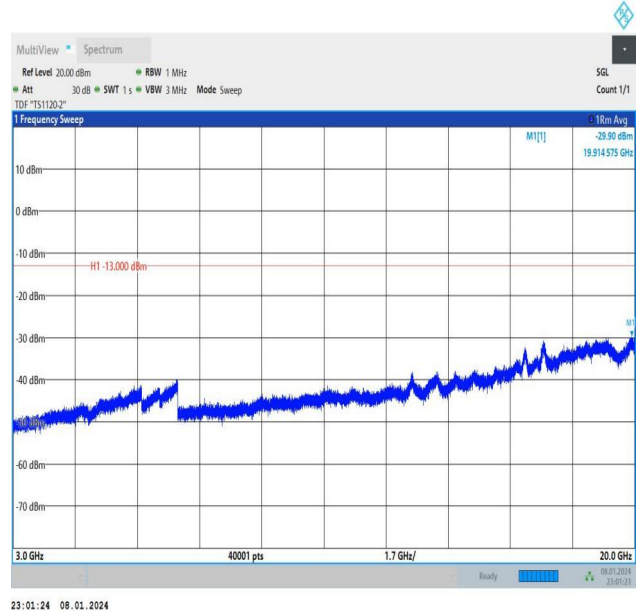


Band2_20MHz_QPSK_18900_100RB#0_3000~20000_3000~20000

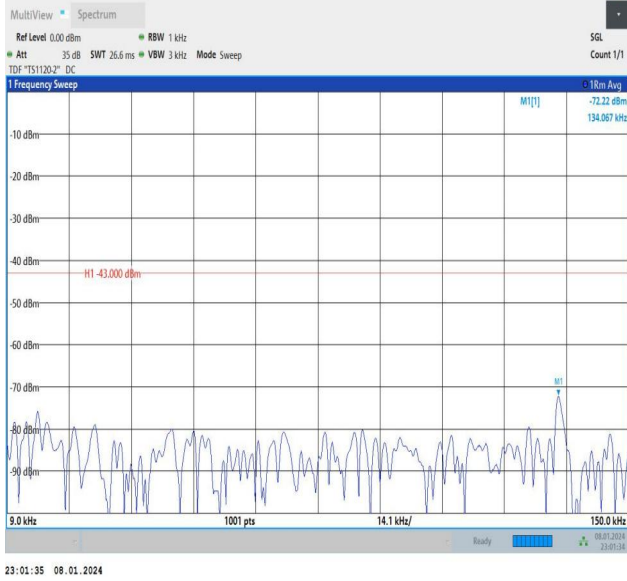


Band2_20MHz_QPSK_19100_100RB#0_0.009~0.15_0.009~0.15

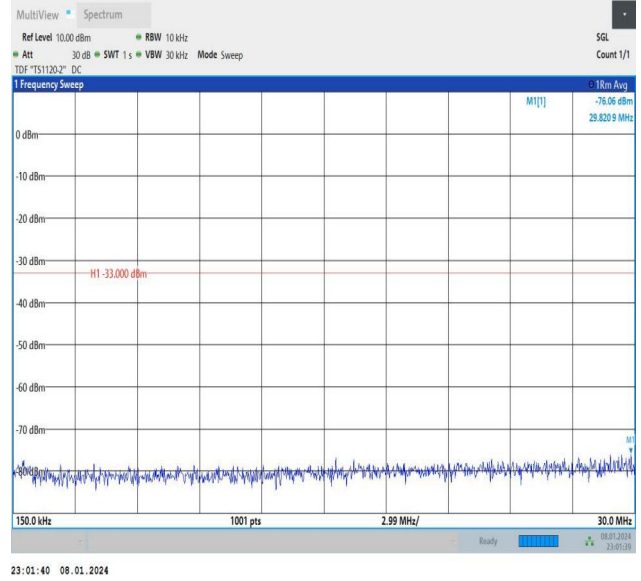

Band2_20MHz_QPSK_19100_100RB#0_0.15~30_0.15~30

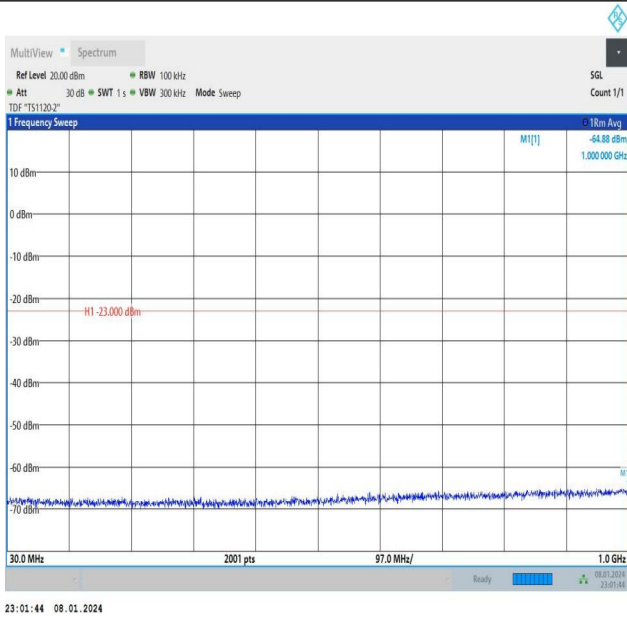

Band2_20MHz_QPSK_19100_100RB#0_30~1000_30~1000

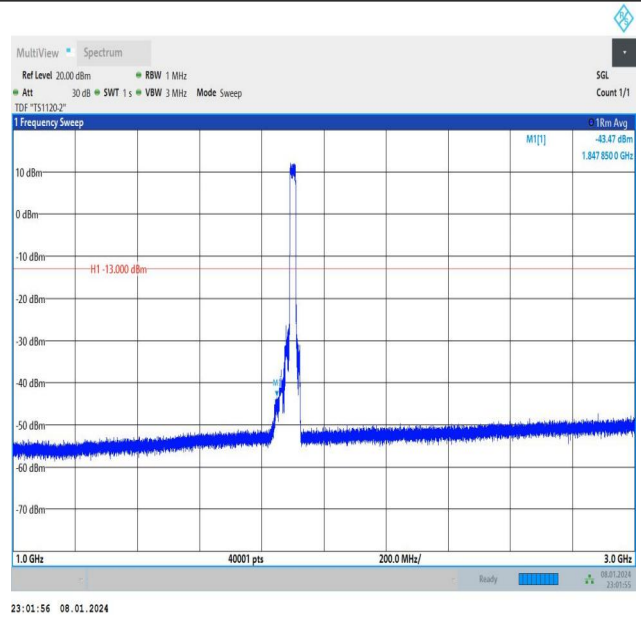

Band2_20MHz_QPSK_19100_100RB#0_1000~3000_1000~3000

MultiView Spectrum Ref Level 20.00 dBm RBW 1 MHz Att 30 dB SWT 1.5 VBW 3 MHz Mode Sweep TDF "TS11202" 1 Frequency Sweep 10 dBm 0 dBm -10 dBm -20 dBm -30 dBm -40 dBm -50 dBm -60 dBm -70 dBm 3.0 GHz 40001 pts 1.7 GHz/ 20.0 GHz 23:02:08 08.01.2024	/
Band2_20MHz_QPSK_19100_100RB#0_3000~20000_3000~20000	/

Frequency Stability

Test Result

Voltage										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	VN	NT	-8.40	-0.004539	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VL	NT	-5.61	-0.003031	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	VH	NT	-9.08	-0.004906	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VN	NT	4.69	0.002495	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VL	NT	-6.68	-0.003553	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	VH	NT	-8.70	-0.004628	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VN	NT	5.22	0.002734	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VL	NT	-12.77	-0.006688	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	VH	NT	-9.87	-0.005169	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VN	NT	-7.18	-0.003880	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VL	NT	-11.54	-0.006235	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	VH	NT	-4.40	-0.002377	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VN	NT	-9.62	-0.005117	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VL	NT	8.90	0.004734	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	VH	NT	-6.41	-0.003410	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VN	NT	-7.08	-0.003708	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VL	NT	-8.42	-0.004410	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	VH	NT	-4.68	-0.002451	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VN	NT	-6.63	-0.003581	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VL	NT	-7.27	-0.003927	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	VH	NT	-5.98	-0.003230	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VN	NT	8.75	0.004654	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VL	NT	-6.73	-0.003580	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	VH	NT	2.67	0.001420	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VN	NT	8.50	0.004454	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VL	NT	-10.31	-0.005402	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	VH	NT	4.86	0.002547	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VN	NT	-8.32	-0.004494	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VL	NT	-7.62	-0.004116	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	VH	NT	-3.93	-0.002123	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VN	NT	-3.29	-0.001750	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VL	NT	-8.30	-0.004415	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	VH	NT	6.82	0.003628	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VN	NT	-7.34	-0.003846	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VL	NT	-4.79	-0.002510	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	VH	NT	-5.56	-0.002913	±2.5	PASS

Band2	5MHz	QPSK	18625	25RB#0	VN	NT	-6.54	-0.003530	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VL	NT	-8.86	-0.004783	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	VH	NT	-8.57	-0.004626	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VN	NT	6.04	0.003213	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VL	NT	-3.40	-0.001809	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	VH	NT	-8.48	-0.004511	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VN	NT	7.90	0.004142	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VL	NT	-9.50	-0.004980	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	VH	NT	-8.57	-0.004493	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VN	NT	-5.14	-0.002775	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VL	NT	5.84	0.003152	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	VH	NT	-6.00	-0.003239	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VN	NT	6.60	0.003511	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VL	NT	-4.93	-0.002622	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	VH	NT	8.78	0.004670	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VN	NT	-6.78	-0.003554	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VL	NT	-4.10	-0.002149	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	VH	NT	-5.04	-0.002642	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VN	NT	-7.40	-0.003989	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VL	NT	-7.32	-0.003946	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	VH	NT	-6.85	-0.003693	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VN	NT	4.90	0.002606	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VL	NT	-8.33	-0.004431	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	VH	NT	-3.60	-0.001915	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VN	NT	6.84	0.003591	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VL	NT	-9.07	-0.004761	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	VH	NT	-10.72	-0.005627	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VN	NT	-10.36	-0.005577	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VL	NT	-8.32	-0.004479	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	VH	NT	-8.00	-0.004307	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VN	NT	8.63	0.004590	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VL	NT	-6.45	-0.003431	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	VH	NT	-12.68	-0.006745	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VN	NT	-8.02	-0.004216	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VL	NT	-5.82	-0.003059	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	VH	NT	-4.99	-0.002623	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VN	NT	-7.56	-0.004065	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VL	NT	-7.32	-0.003935	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	VH	NT	-8.06	-0.004333	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VN	NT	3.60	0.001915	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	VL	NT	-10.45	-0.005559	±2.5	PASS

Band2	20MHz	QPSK	18900	100RB#0	VH	NT	-7.70	-0.004096	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VN	NT	-5.49	-0.002889	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VL	NT	-11.42	-0.006011	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	VH	NT	-6.69	-0.003521	±2.5	PASS

Temperature										
Band	Bandwidth	Modulation	Channel	RB Configure	Voltage [Vdc]	Temperature (°C)	Deviation (Hz)	Deviation (ppm)	Limit (ppm)	Verdict
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-30	-7.02	-0.003793	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-20	-7.33	-0.003961	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	-10	-10.19	-0.005506	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	0	-8.05	-0.004350	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	10	-7.93	-0.004285	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	20	-6.98	-0.003772	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	30	-9.52	-0.005144	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	40	-12.50	-0.006754	±2.5	PASS
Band2	1.4MHz	QPSK	18607	6RB#0	NV	50	-7.80	-0.004215	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-30	-4.81	-0.002559	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-20	-6.57	-0.003495	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	-10	4.08	0.002170	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	0	-9.03	-0.004803	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	10	-5.21	-0.002771	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	20	-8.61	-0.004580	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	30	-7.69	-0.004090	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	40	-7.17	-0.003814	±2.5	PASS
Band2	1.4MHz	QPSK	18900	6RB#0	NV	50	-4.60	-0.002447	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-30	-9.63	-0.005044	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-20	-13.04	-0.006830	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	-10	-9.69	-0.005075	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	0	-8.65	-0.004530	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	10	-10.46	-0.005478	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	20	-8.05	-0.004216	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	30	-8.52	-0.004462	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	40	-6.30	-0.003300	±2.5	PASS
Band2	1.4MHz	QPSK	19193	6RB#0	NV	50	-13.70	-0.007175	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-30	-6.53	-0.003528	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-20	-4.51	-0.002437	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	-10	-4.85	-0.002621	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	0	-4.61	-0.002491	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	10	-6.04	-0.003264	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	20	-4.63	-0.002502	±2.5	PASS

Band2	1.4MHz	16QAM	18607	6RB#0	NV	30	7.08	0.003826	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	40	-4.34	-0.002345	±2.5	PASS
Band2	1.4MHz	16QAM	18607	6RB#0	NV	50	-7.61	-0.004112	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-30	-7.03	-0.003739	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-20	-5.19	-0.002761	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	-10	-6.97	-0.003707	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	0	-3.50	-0.001862	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	10	-4.79	-0.002548	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	20	-9.14	-0.004862	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	30	4.46	0.002372	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	40	-5.15	-0.002739	±2.5	PASS
Band2	1.4MHz	16QAM	18900	6RB#0	NV	50	5.77	0.003069	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-30	-9.16	-0.004798	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-20	-7.40	-0.003876	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	-10	-6.59	-0.003452	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	0	-5.96	-0.003122	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	10	-5.75	-0.003012	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	20	-4.02	-0.002105	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	30	-8.10	-0.004242	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	40	-7.47	-0.003912	±2.5	PASS
Band2	1.4MHz	16QAM	19193	6RB#0	NV	50	-8.63	-0.004520	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-30	-6.48	-0.003500	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-20	-7.43	-0.004013	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	-10	-5.03	-0.002717	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	0	-7.31	-0.003948	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	10	-6.36	-0.003435	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	20	-4.72	-0.002549	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	30	-6.68	-0.003608	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	40	-4.23	-0.002285	±2.5	PASS
Band2	3MHz	QPSK	18615	15RB#0	NV	50	4.73	0.002555	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-30	-6.10	-0.003245	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-20	-6.22	-0.003309	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	-10	5.97	0.003176	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	0	-5.71	-0.003037	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	10	-6.63	-0.003527	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	20	-5.77	-0.003069	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	30	-4.40	-0.002340	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	40	-7.83	-0.004165	±2.5	PASS
Band2	3MHz	QPSK	18900	15RB#0	NV	50	-4.85	-0.002580	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-30	-10.25	-0.005371	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	-20	-8.43	-0.004417	±2.5	PASS

Band2	3MHz	QPSK	19185	15RB#0	NV	-10	-6.51	-0.003411	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	0	-8.97	-0.004700	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	10	-7.05	-0.003694	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	20	-7.32	-0.003835	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	30	-7.37	-0.003862	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	40	-5.47	-0.002866	±2.5	PASS
Band2	3MHz	QPSK	19185	15RB#0	NV	50	-8.53	-0.004469	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-30	-6.05	-0.003268	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-20	-6.32	-0.003413	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	-10	-7.04	-0.003802	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	0	7.16	0.003867	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	10	3.68	0.001988	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	20	2.85	0.001539	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	30	4.61	0.002490	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	40	-5.93	-0.003203	±2.5	PASS
Band2	3MHz	16QAM	18615	15RB#0	NV	50	-4.32	-0.002333	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-30	7.73	0.004112	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-20	-4.59	-0.002441	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	-10	6.03	0.003207	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	0	2.15	0.001144	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	10	5.23	0.002782	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	20	6.13	0.003261	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	30	4.85	0.002580	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	40	-5.99	-0.003186	±2.5	PASS
Band2	3MHz	16QAM	18900	15RB#0	NV	50	-3.61	-0.001920	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-30	-3.84	-0.002012	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-20	-5.64	-0.002955	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	-10	2.61	0.001368	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	0	7.60	0.003982	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	10	-6.41	-0.003359	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	20	3.20	0.001677	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	30	-10.31	-0.005402	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	40	-6.65	-0.003484	±2.5	PASS
Band2	3MHz	16QAM	19185	15RB#0	NV	50	-7.70	-0.004035	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-30	-9.77	-0.005274	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-20	-8.03	-0.004335	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	-10	-10.74	-0.005798	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	0	-8.57	-0.004626	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	10	-8.81	-0.004756	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	20	-9.44	-0.005096	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	30	-7.09	-0.003827	±2.5	PASS

Band2	5MHz	QPSK	18625	25RB#0	NV	40	-7.30	-0.003941	±2.5	PASS
Band2	5MHz	QPSK	18625	25RB#0	NV	50	-4.76	-0.002570	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-30	-8.14	-0.004330	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-20	-7.03	-0.003739	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	-10	-9.71	-0.005165	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	0	-5.70	-0.003032	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	10	-4.85	-0.002580	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	20	-4.09	-0.002176	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	30	7.41	0.003941	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	40	8.83	0.004697	±2.5	PASS
Band2	5MHz	QPSK	18900	25RB#0	NV	50	6.69	0.003559	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-30	-14.55	-0.007628	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-20	-5.36	-0.002810	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	-10	-7.27	-0.003811	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	0	-6.85	-0.003591	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	10	-4.80	-0.002516	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	20	-9.79	-0.005132	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	30	-5.47	-0.002868	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	40	-6.91	-0.003623	±2.5	PASS
Band2	5MHz	QPSK	19175	25RB#0	NV	50	-6.85	-0.003591	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-30	-5.74	-0.003099	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-20	-7.97	-0.004302	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	-10	3.16	0.001706	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	0	-6.54	-0.003530	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	10	4.99	0.002694	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	20	-10.28	-0.005549	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	30	6.87	0.003709	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	40	-5.20	-0.002807	±2.5	PASS
Band2	5MHz	16QAM	18625	25RB#0	NV	50	3.07	0.001657	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-30	8.46	0.004500	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-20	-4.83	-0.002569	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	-10	-5.60	-0.002979	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	0	3.94	0.002096	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	10	4.65	0.002473	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	20	-6.22	-0.003309	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	30	5.32	0.002830	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	40	4.76	0.002532	±2.5	PASS
Band2	5MHz	16QAM	18900	25RB#0	NV	50	-3.47	-0.001846	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-30	8.00	0.004194	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-20	-5.41	-0.002836	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	-10	-3.02	-0.001583	±2.5	PASS

Band2	5MHz	16QAM	19175	25RB#0	NV	0	-4.53	-0.002375	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	10	-8.93	-0.004682	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	20	6.95	0.003644	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	30	-2.83	-0.001484	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	40	8.28	0.004341	±2.5	PASS
Band2	5MHz	16QAM	19175	25RB#0	NV	50	-8.46	-0.004435	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-30	-3.50	-0.001887	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-20	-6.63	-0.003574	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	-10	-8.11	-0.004372	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	0	-7.75	-0.004178	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	10	-7.19	-0.003876	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	20	5.43	0.002927	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	30	-6.68	-0.003601	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	40	4.46	0.002404	±2.5	PASS
Band2	10MHz	QPSK	18650	50RB#0	NV	50	-7.58	-0.004086	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-30	-6.09	-0.003239	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-20	-6.07	-0.003229	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	-10	-4.18	-0.002223	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	0	-5.63	-0.002995	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	10	-8.70	-0.004628	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	20	-4.29	-0.002282	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	30	7.59	0.004037	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	40	3.87	0.002059	±2.5	PASS
Band2	10MHz	QPSK	18900	50RB#0	NV	50	5.16	0.002745	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-30	-8.56	-0.004493	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-20	-12.36	-0.006488	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	-10	4.50	0.002362	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	0	-8.25	-0.004331	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	10	-7.93	-0.004163	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	20	-8.59	-0.004509	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	30	5.62	0.002950	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	40	-8.55	-0.004488	±2.5	PASS
Band2	10MHz	QPSK	19150	50RB#0	NV	50	-6.31	-0.003312	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-30	-9.53	-0.005131	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-20	-8.10	-0.004361	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	-10	-6.72	-0.003618	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	0	-5.20	-0.002799	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	10	-9.92	-0.005341	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	20	-8.66	-0.004662	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	30	-6.92	-0.003725	±2.5	PASS
Band2	15MHz	QPSK	18675	75RB#0	NV	40	2.63	0.001416	±2.5	PASS

Band2	15MHz	QPSK	18675	75RB#0	NV	50	-8.29	-0.004463	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-30	-4.47	-0.002378	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-20	-4.78	-0.002543	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	-10	-7.59	-0.004037	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	0	-6.67	-0.003548	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	10	-6.04	-0.003213	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	20	-6.93	-0.003686	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	30	-8.29	-0.004410	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	40	-5.26	-0.002798	±2.5	PASS
Band2	15MHz	QPSK	18900	75RB#0	NV	50	-6.53	-0.003473	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-30	-6.12	-0.003217	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-20	-7.00	-0.003679	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	-10	-10.12	-0.005319	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	0	-7.22	-0.003795	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	10	-10.45	-0.005493	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	20	-7.83	-0.004116	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	30	5.80	0.003049	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	40	-5.77	-0.003033	±2.5	PASS
Band2	15MHz	QPSK	19125	75RB#0	NV	50	-9.31	-0.004894	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-30	-7.06	-0.003796	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-20	-8.82	-0.004742	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	-10	-4.94	-0.002656	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	0	-7.58	-0.004075	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	10	-4.15	-0.002231	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	20	-5.87	-0.003156	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	30	-7.84	-0.004215	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	40	-7.47	-0.004016	±2.5	PASS
Band2	20MHz	QPSK	18700	100RB#0	NV	50	-5.98	-0.003215	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-30	-7.69	-0.004090	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-20	-10.17	-0.005410	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	-10	5.72	0.003043	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	0	-5.93	-0.003154	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	10	-6.56	-0.003489	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	20	-4.76	-0.002532	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	30	-4.81	-0.002559	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	40	-3.96	-0.002106	±2.5	PASS
Band2	20MHz	QPSK	18900	100RB#0	NV	50	-3.93	-0.002090	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-30	-5.72	-0.003011	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-20	-6.81	-0.003584	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	-10	-6.06	-0.003189	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	0	-4.72	-0.002484	±2.5	PASS

Band2	20MHz	QPSK	19100	100RB#0	NV	10	-7.89	-0.004153	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	20	-7.14	-0.003758	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	30	6.53	0.003437	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	40	4.81	0.002532	±2.5	PASS
Band2	20MHz	QPSK	19100	100RB#0	NV	50	-6.95	-0.003658	±2.5	PASS