



Conducted Emission Method

Test Result

Ant0:

TestMode	Antenna	Frequency[MHz]	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant0	2402	0~Reference	1.30	1.30	---	PASS
DH5	Ant0	2402	30~1000	1.30	-58.21	≤-18.7	PASS
DH5	Ant0	2402	1000~26500	1.30	-43.28	≤-18.7	PASS
DH5	Ant0	2441	0~Reference	2.41	2.41	---	PASS
DH5	Ant0	2441	30~1000	2.41	-57.57	≤-17.59	PASS
DH5	Ant0	2441	1000~26500	2.41	-43.26	≤-17.59	PASS
DH5	Ant0	2480	0~Reference	3.04	3.04	---	PASS
DH5	Ant0	2480	30~1000	3.04	-58.2	≤-16.96	PASS
DH5	Ant0	2480	1000~26500	3.04	-43.07	≤-16.96	PASS
2DH5	Ant0	2402	0~Reference	-1.58	-1.58	---	PASS
2DH5	Ant0	2402	30~1000	-1.58	-58.03	≤-21.58	PASS
2DH5	Ant0	2402	1000~26500	-1.58	-42.03	≤-21.58	PASS
2DH5	Ant0	2441	0~Reference	-0.89	-0.89	---	PASS
2DH5	Ant0	2441	30~1000	-0.89	-57.41	≤-20.89	PASS
2DH5	Ant0	2441	1000~26500	-0.89	-42.7	≤-20.89	PASS
2DH5	Ant0	2480	0~Reference	1.53	1.53	---	PASS
2DH5	Ant0	2480	30~1000	1.53	-57.07	≤-18.47	PASS
2DH5	Ant0	2480	1000~26500	1.53	-42.36	≤-18.47	PASS
3DH5	Ant0	2402	0~Reference	-0.37	-0.37	---	PASS
3DH5	Ant0	2402	30~1000	-0.37	-57.75	≤-20.37	PASS
3DH5	Ant0	2402	1000~26500	-0.37	-41.7	≤-20.37	PASS
3DH5	Ant0	2441	0~Reference	0.36	0.36	---	PASS
3DH5	Ant0	2441	30~1000	0.36	-58.29	≤-19.64	PASS
3DH5	Ant0	2441	1000~26500	0.36	-42.41	≤-19.64	PASS
3DH5	Ant0	2480	0~Reference	-1.72	-1.72	---	PASS
3DH5	Ant0	2480	30~1000	-1.72	-57.61	≤-21.72	PASS
3DH5	Ant0	2480	1000~26500	-1.72	-42.36	≤-21.72	PASS

Ant2:

TestMode	Antenna	Frequency[MHz]	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant2	2402	0~Reference	2.15	2.15	---	PASS
DH5	Ant2	2402	30~1000	2.15	-56.71	≤-17.85	PASS
DH5	Ant2	2402	1000~26500	2.15	-41.84	≤-17.85	PASS
DH5	Ant2	2441	0~Reference	3.13	3.13	---	PASS
DH5	Ant2	2441	30~1000	3.13	-57.46	≤-16.87	PASS
DH5	Ant2	2441	1000~26500	3.13	-42.39	≤-16.87	PASS
DH5	Ant2	2480	0~Reference	3.27	3.27	---	PASS
DH5	Ant2	2480	30~1000	3.27	-57.88	≤-16.73	PASS
DH5	Ant2	2480	1000~26500	3.27	-41.46	≤-16.73	PASS
2DH5	Ant2	2402	0~Reference	-1.56	-1.56	---	PASS
2DH5	Ant2	2402	30~1000	-1.56	-57.54	≤-21.56	PASS
2DH5	Ant2	2402	1000~26500	-1.56	-41.23	≤-21.56	PASS
2DH5	Ant2	2441	0~Reference	-0.74	-0.74	---	PASS
2DH5	Ant2	2441	30~1000	-0.74	-57.16	≤-20.74	PASS



2DH5	Ant2	2441	1000~26500	-0.74	-42.27	≤-20.74	PASS
2DH5	Ant2	2480	0~Reference	1.45	1.45	---	PASS
2DH5	Ant2	2480	30~1000	1.45	-57.92	≤-18.55	PASS
2DH5	Ant2	2480	1000~26500	1.45	-42.1	≤-18.55	PASS
3DH5	Ant2	2402	0~Reference	-0.13	-0.13	---	PASS
3DH5	Ant2	2402	30~1000	-0.13	-57.7	≤-20.13	PASS
3DH5	Ant2	2402	1000~26500	-0.13	-41.75	≤-20.13	PASS
3DH5	Ant2	2441	0~Reference	-0.16	-0.16	---	PASS
3DH5	Ant2	2441	30~1000	-0.16	-57.73	≤-20.16	PASS
3DH5	Ant2	2441	1000~26500	-0.16	-42.28	≤-20.16	PASS
3DH5	Ant2	2480	0~Reference	-1.41	-1.41	---	PASS
3DH5	Ant2	2480	30~1000	-1.41	-57.19	≤-21.41	PASS
3DH5	Ant2	2480	1000~26500	-1.41	-42.11	≤-21.41	PASS

Ant4:

TestMode	Antenna	Frequency[MHz]	FreqRange [MHz]	RefLevel [dBm]	Result [dBm]	Limit [dBm]	Verdict
DH5	Ant4	2402	0~Reference	2.12	2.12	---	PASS
DH5	Ant4	2402	30~1000	2.12	-57.34	≤-17.88	PASS
DH5	Ant4	2402	1000~26500	2.12	-41.98	≤-17.88	PASS
DH5	Ant4	2441	0~Reference	2.96	2.96	---	PASS
DH5	Ant4	2441	30~1000	2.96	-57.95	≤-17.04	PASS
DH5	Ant4	2441	1000~26500	2.96	-42.07	≤-17.04	PASS
DH5	Ant4	2480	0~Reference	2.99	2.99	---	PASS
DH5	Ant4	2480	30~1000	2.99	-57.77	≤-17.01	PASS
DH5	Ant4	2480	1000~26500	2.99	-42.01	≤-17.01	PASS
2DH5	Ant4	2402	0~Reference	-1.72	-1.72	---	PASS
2DH5	Ant4	2402	30~1000	-1.72	-56.93	≤-21.72	PASS
2DH5	Ant4	2402	1000~26500	-1.72	-42.18	≤-21.72	PASS
2DH5	Ant4	2441	0~Reference	0.35	0.35	---	PASS
2DH5	Ant4	2441	30~1000	0.35	-57.82	≤-19.65	PASS
2DH5	Ant4	2441	1000~26500	0.35	-42.13	≤-19.65	PASS
2DH5	Ant4	2480	0~Reference	0.98	0.98	---	PASS
2DH5	Ant4	2480	30~1000	0.98	-57.71	≤-19.02	PASS
2DH5	Ant4	2480	1000~26500	0.98	-42.29	≤-19.02	PASS
3DH5	Ant4	2402	0~Reference	-0.61	-0.61	---	PASS
3DH5	Ant4	2402	30~1000	-0.61	-57.02	≤-20.61	PASS
3DH5	Ant4	2402	1000~26500	-0.61	-41.39	≤-20.61	PASS
3DH5	Ant4	2441	0~Reference	-1.10	-1.10	---	PASS
3DH5	Ant4	2441	30~1000	-1.10	-56.87	≤-21.1	PASS
3DH5	Ant4	2441	1000~26500	-1.10	-42.04	≤-21.1	PASS
3DH5	Ant4	2480	0~Reference	0.83	0.83	---	PASS
3DH5	Ant4	2480	30~1000	0.83	-57.93	≤-19.17	PASS
3DH5	Ant4	2480	1000~26500	0.83	-42.05	≤-19.17	PASS




Ant0:


DH5-Ant0-2402-0~Reference-PASS



DH5-Ant0-2402-30~1000-PASS

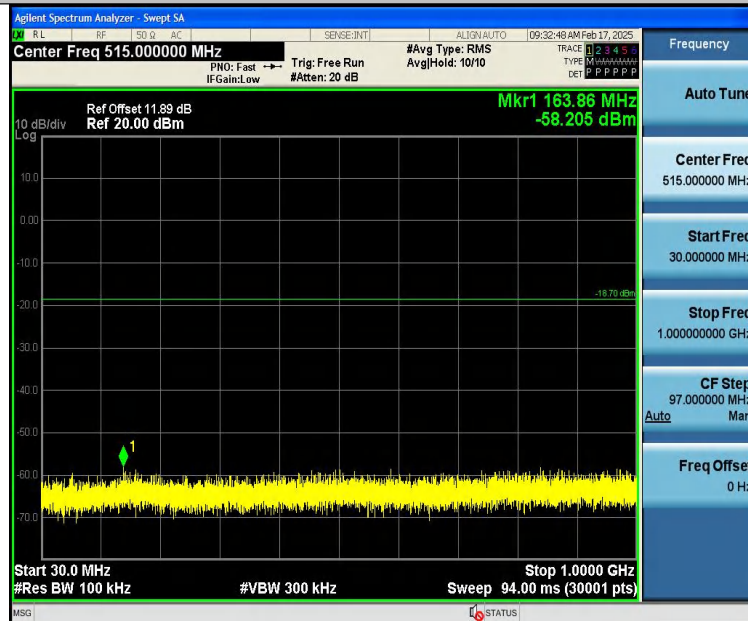


DH5-Ant0-2402-1000~26500-PASS

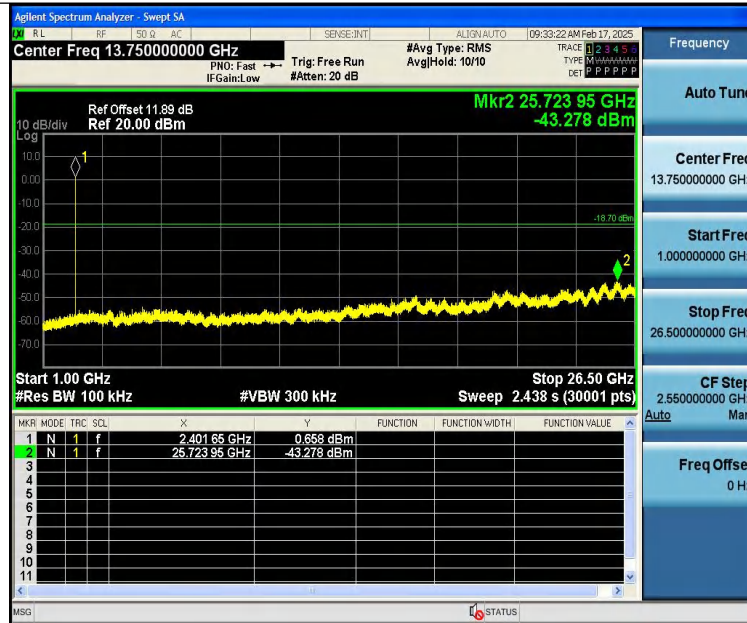

DH5-Ant0-2441-0~Reference-PASS



DH5-Ant0-2441-30~1000-PASS

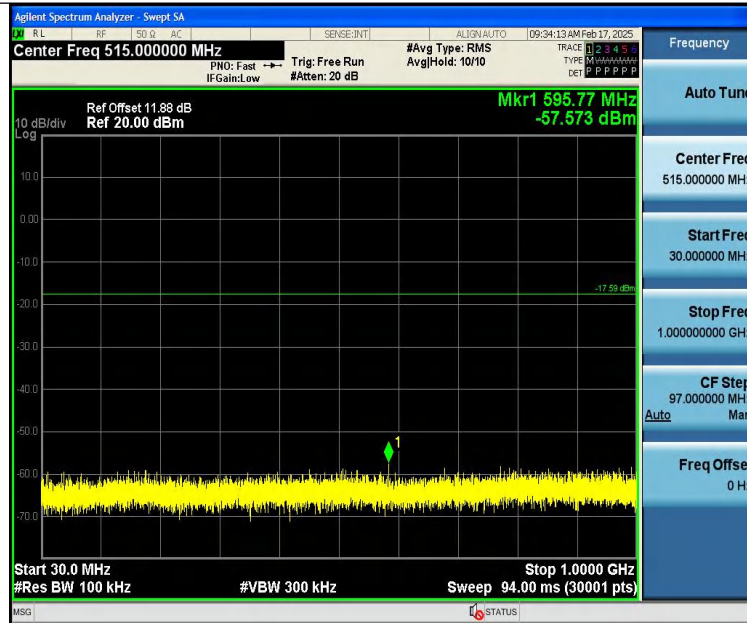

DH5-Ant0-2441-1000~26500-PASS




DH5-Ant0-2480-0~Reference-PASS



DH5-Ant0-2480-30~1000-PASS




DH5-Ant0-2480-1000~26500-PASS

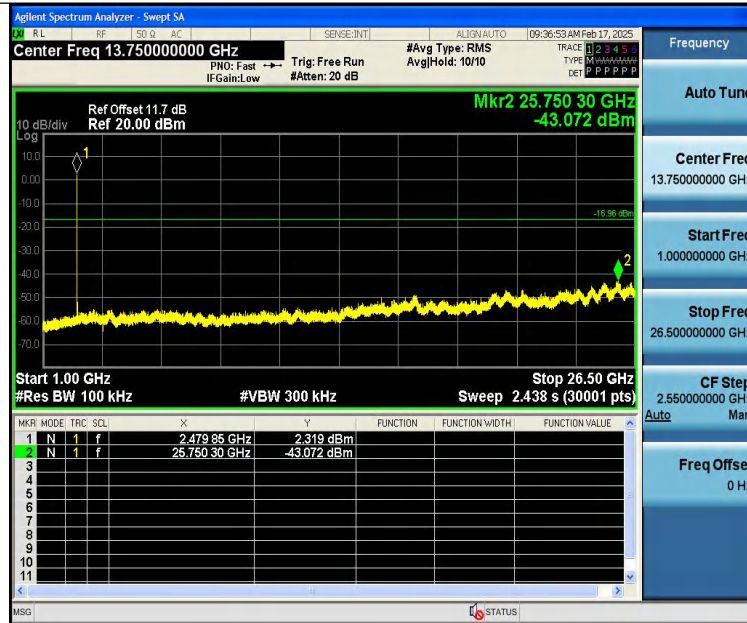

2DH5-Ant0-2402-0~Reference-PASS



2DH5-Ant0-2402-30~1000-PASS

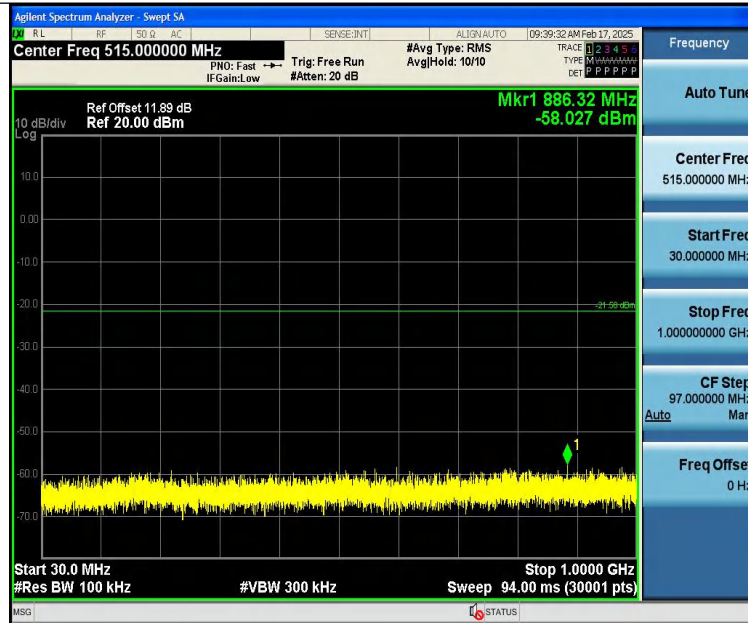

2DH5-Ant0-2402-1000~26500-PASS




2DH5-Ant0-2441-0~Reference-PASS



2DH5-Ant0-2441-30~1000-PASS




2DH5-Ant0-2441-1000~26500-PASS

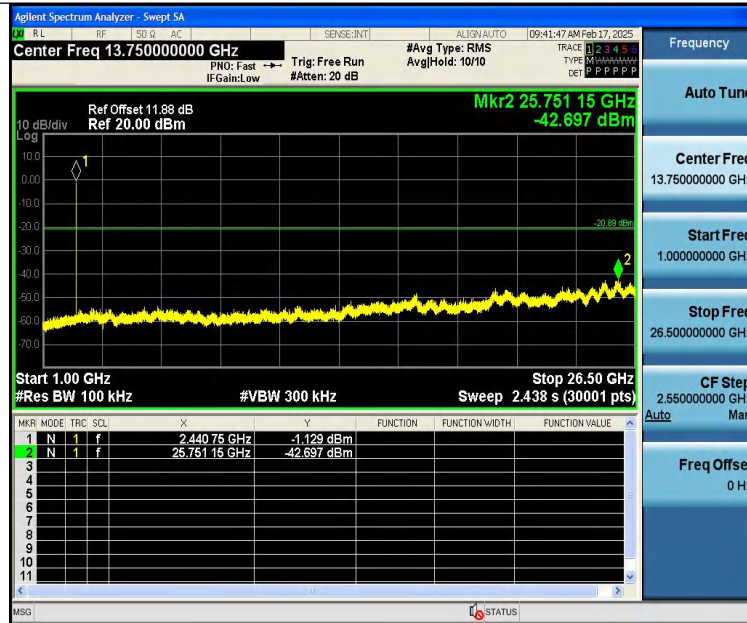

2DH5-Ant0-2480-0~Reference-PASS



2DH5-Ant0-2480-30~1000-PASS

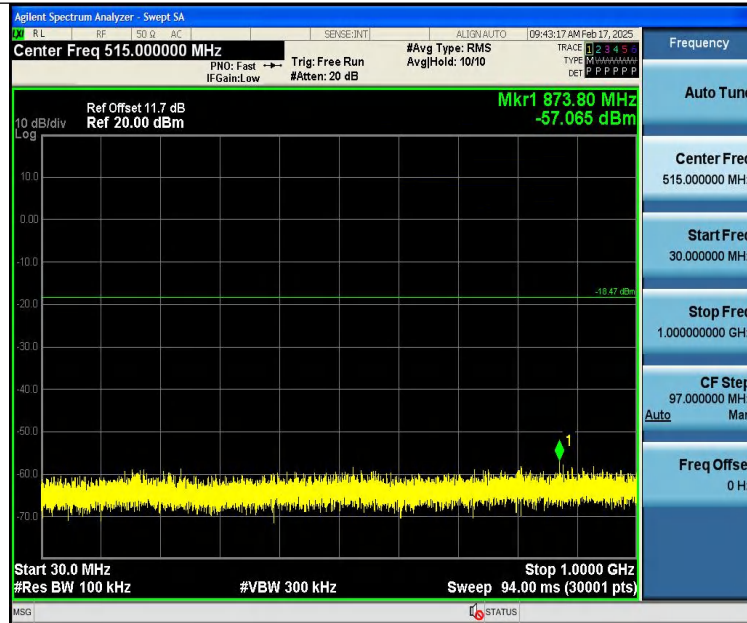

2DH5-Ant0-2480-1000~26500-PASS




3DH5-Ant0-2402-0~Reference-PASS



3DH5-Ant0-2402-30~1000-PASS




3DH5-Ant0-2402-1000~26500-PASS

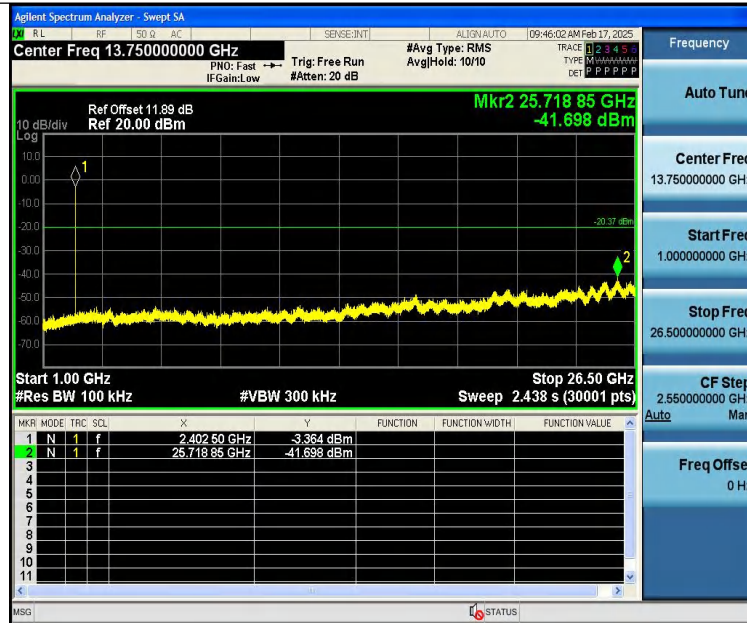


3DH5-Ant0-2441-0~Reference-PASS



3DH5-Ant0-2441-30~1000-PASS

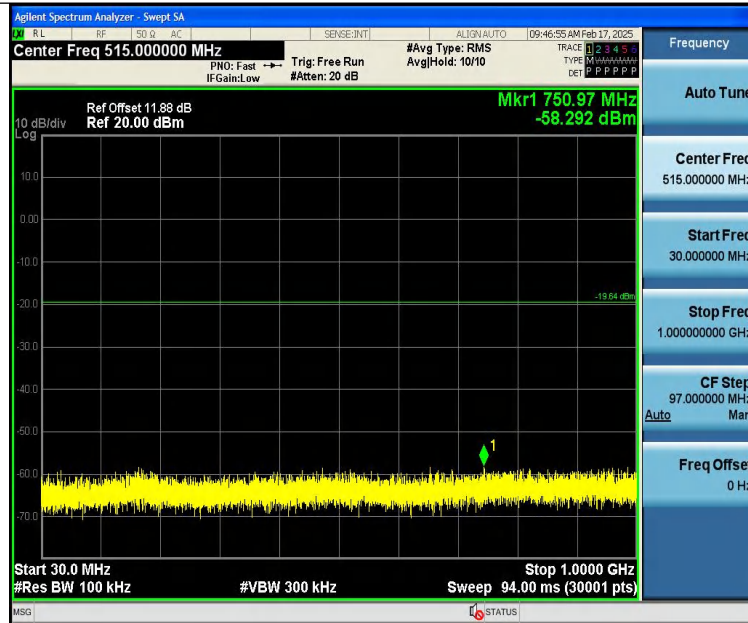

3DH5-Ant0-2441-1000~26500-PASS

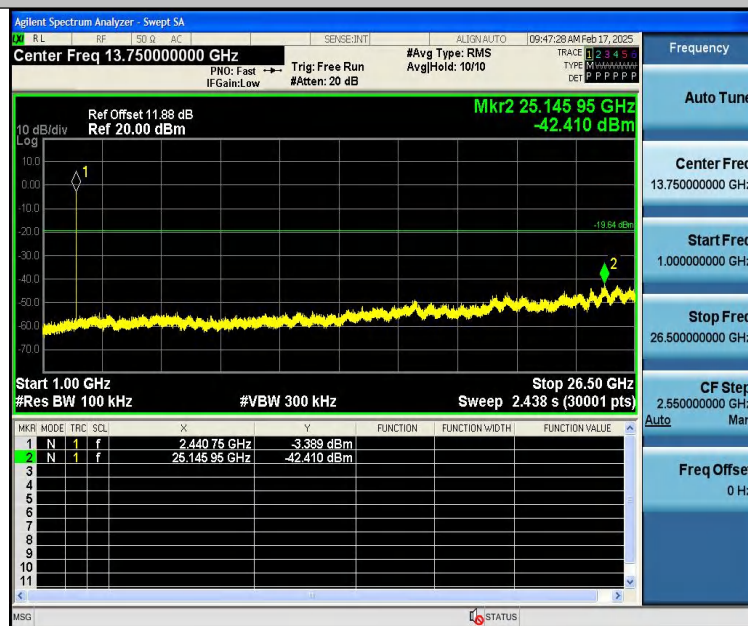


3DH5-Ant0-2480-0~Reference-PASS



3DH5-Ant0-2480-30~1000-PASS



3DH5-Ant0-2480-1000~26500-PASS

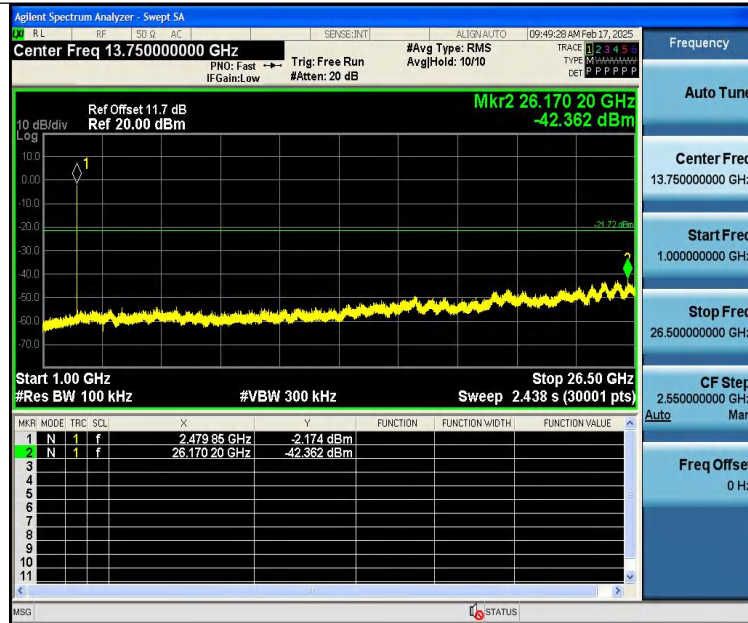


Ant2:

DH5-Ant2-2402-0~Reference-PASS



DH5-Ant2-2402-30~1000-PASS

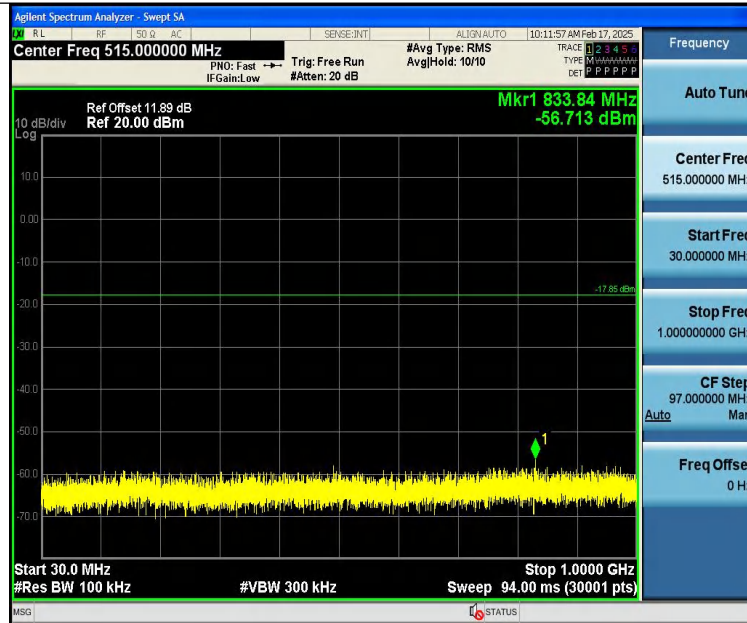

DH5-Ant2-2402-1000~26500-PASS




DH5-Ant2-2441-0~Reference-PASS



DH5-Ant2-2441-30~1000-PASS




DH5-Ant2-2441-1000~26500-PASS

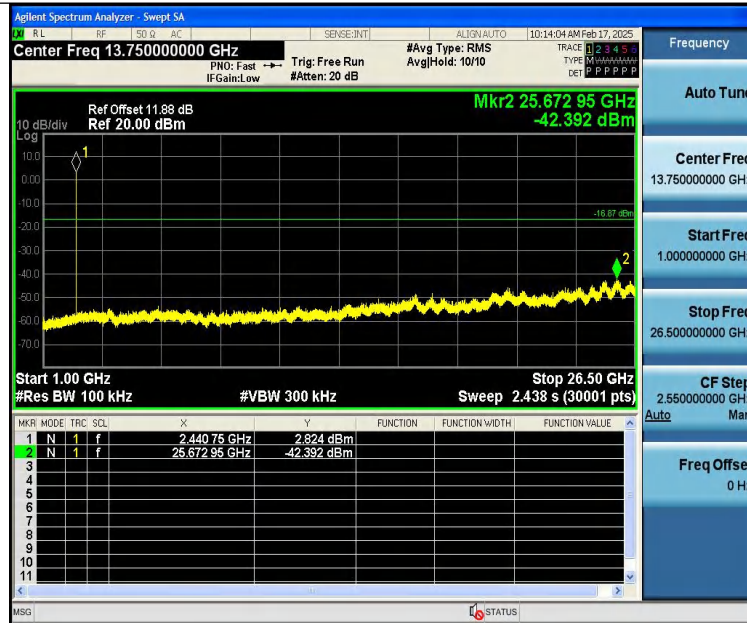

DH5-Ant2-2480-0~Reference-PASS



DH5-Ant2-2480-30~1000-PASS

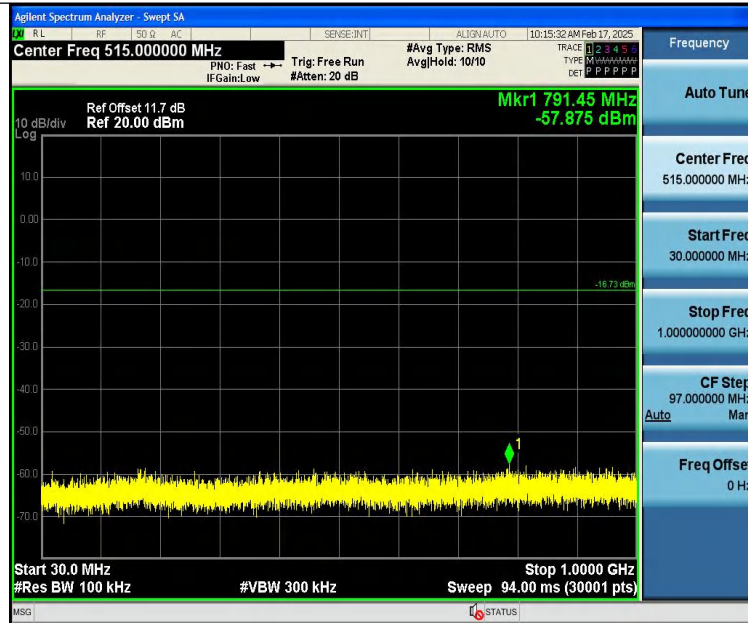

DH5-Ant2-2480-1000~26500-PASS




2DH5-Ant2-2402-0~Reference-PASS



2DH5-Ant2-2402-30~1000-PASS




2DH5-Ant2-2402-1000~26500-PASS

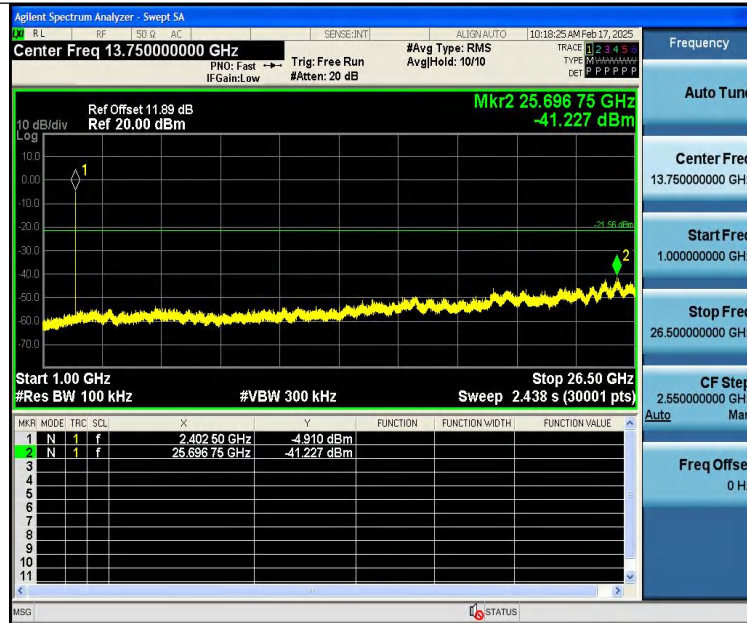

2DH5-Ant2-2441-0~Reference-PASS



2DH5-Ant2-2441-30~1000-PASS

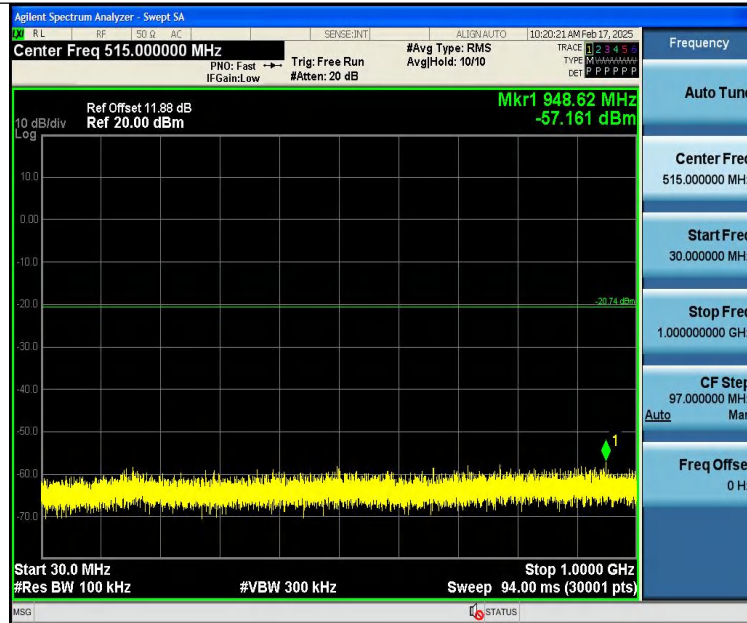


2DH5-Ant2-2441-1000~26500-PASS




2DH5-Ant2-2480-0~Reference-PASS



2DH5-Ant2-2480-30~1000-PASS

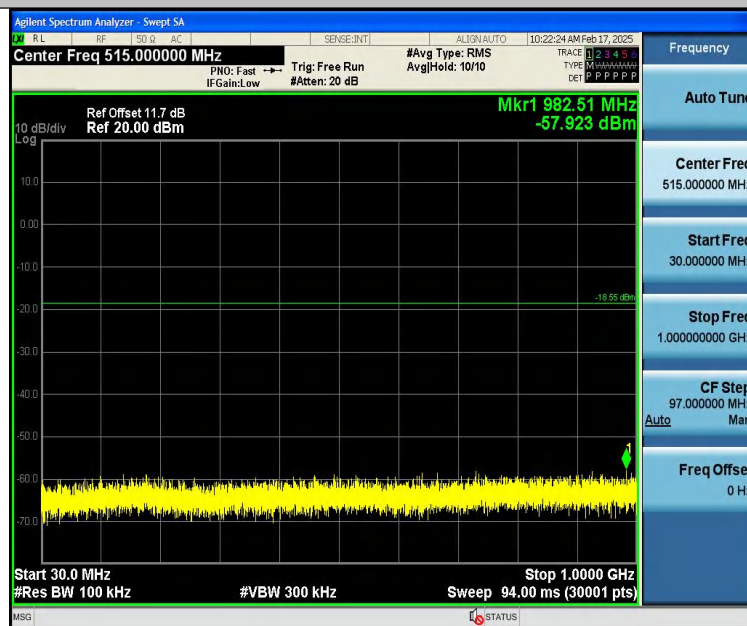


2DH5-Ant2-2480-1000~26500-PASS

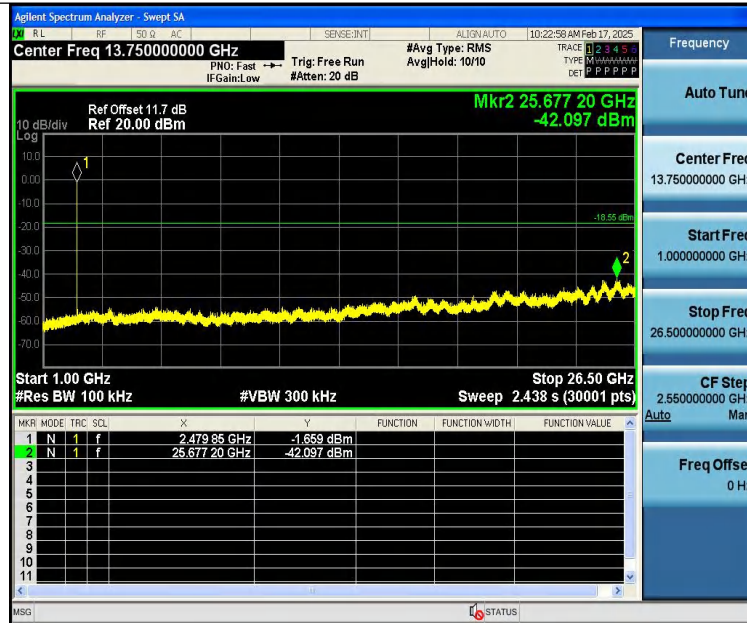

3DH5-Ant2-2402-0~Reference-PASS



3DH5-Ant2-2402-30~1000-PASS

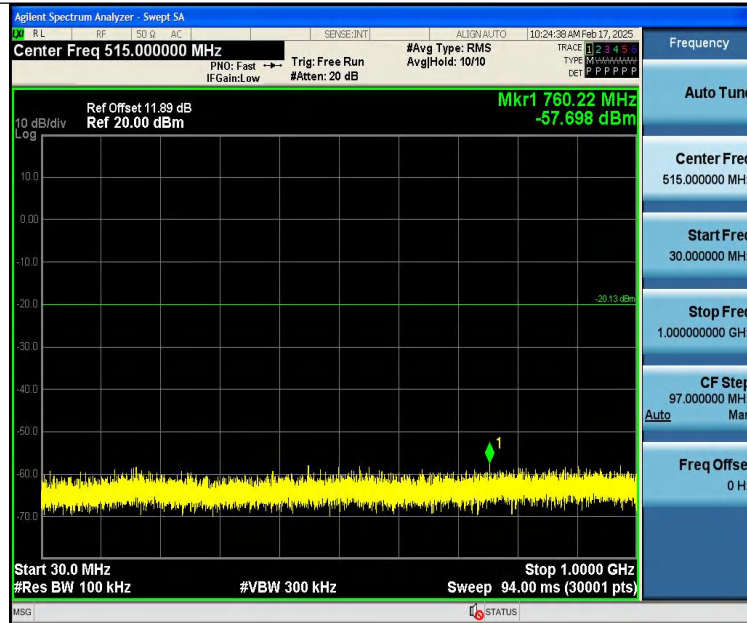

3DH5-Ant2-2402-1000~26500-PASS




3DH5-Ant2-2441-0~Reference-PASS



3DH5-Ant2-2441-30~1000-PASS




3DH5-Ant2-2441-1000~26500-PASS

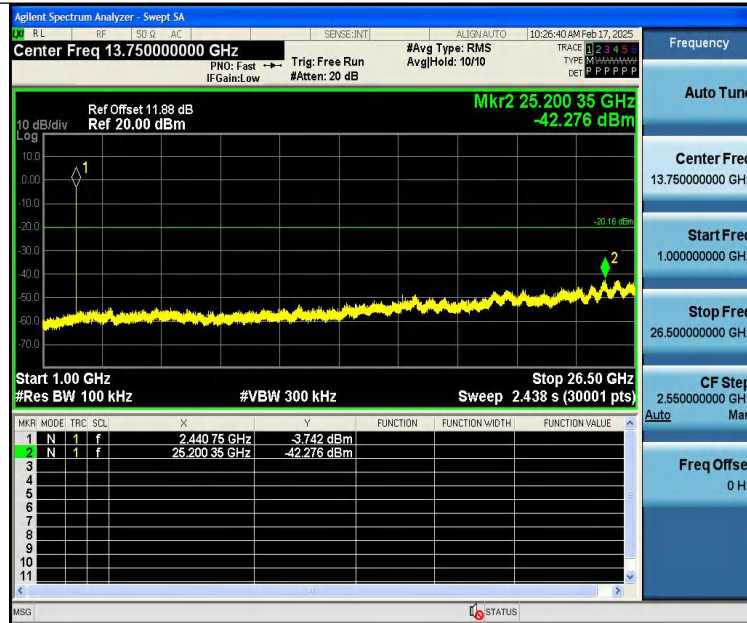

3DH5-Ant2-2480-0~Reference-PASS



3DH5-Ant2-2480-30~1000-PASS

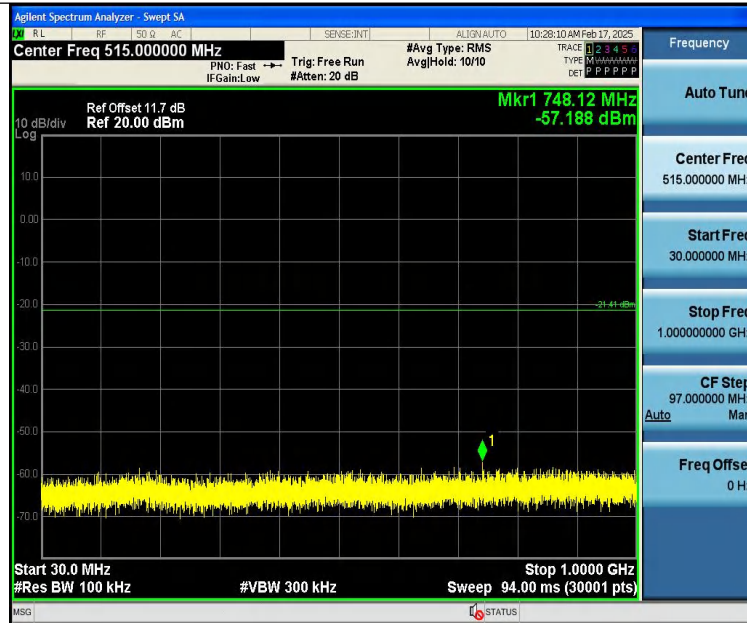

3DH5-Ant2-2480-1000~26500-PASS






Ant4:

DH5-Ant4-2402-0~Reference-PASS



DH5-Ant4-2402-30~1000-PASS

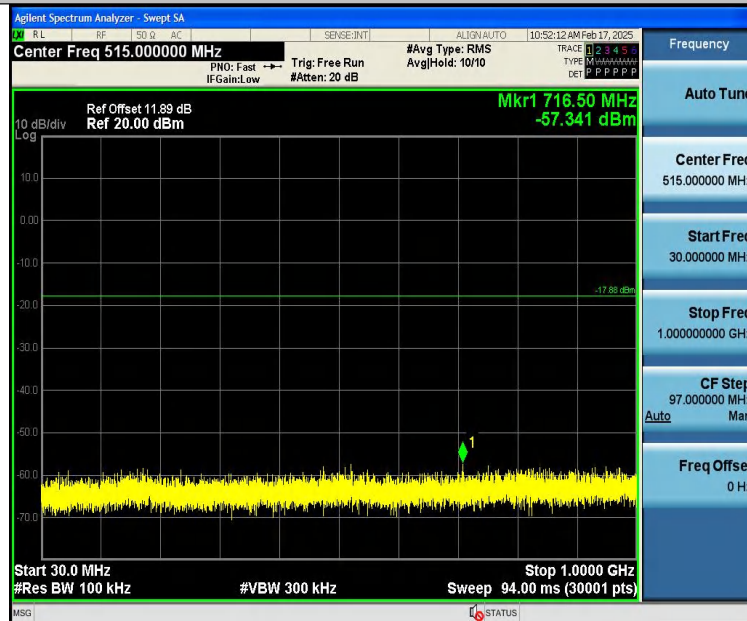

DH5-Ant4-2402-1000~26500-PASS